

Operating Instruction for True RMS Multimeter & Oscilloscope with Meterbox



Please read this manual before switching the unit on.
Important safety information inside.

Content	Page
Part 1. Operating Instruction for True RMS Multimeter	5
1. Introduction	6
2. Safety	6
2-1. International Safety Symbols	6
2-2. PER IEC1010 Overvoltage Installation Category	7
2-3. Safety Instructions	7
2-4. Input Limits	8
2-5. FCC Compliance Statement	8
3. Description	9
3-1. Meter Description	9
3-2. Understanding the Push Buttons	10
3-3. Understanding the Rotary Switch	11
3-4. Using the Input Terminals	12
3-5. Understanding the Display	13
4. Measurement and Setup	14
4-1. DC Voltage Measurement	14
4-2. AC Voltage Measurement	15
4-3. Making dB Measurement	16
4-4. Low Pass Filter	16
4-5. mV Voltage Measurement	17
4-6. Temperature Measurement	18
4-7. Frequency Measurement	19
4-8. Resistance Measurement	20
4-9. Continuity Check	21
4-10. Diode Test	22
4-11. Capacitance Measurement	23
4-12. DC Current Measurement	24
4-13. AC Current Measurement	25
4-14. Understanding Function Menus	26
4-15. Using Help	26
4-16. Measuring AC and DC Signals	26
4-17. Capturing Minimum and Maximum Values	27
4-18. Capturing Peak Values	28
4-19. Relative Values	28
4-20. Low Pass Filter	28
4-21. Hold and AutoHold Mode	29
4-22. Storing Individual Measurement Data	29
4-23. Viewing Memory Data	29
4-24. Viewing Trend Data	30
4-25. Recording Measurement Data	30
4-26. Zooming in on Trend Data	31
4-27. Changing Meter Setup Options	31
4-28. Resetting Meter Setup Options	31
4-29. Meter Info	31
4-30. Setting the Event Threshold Value	32
4-31. Calibration	32
4-32. Using Communications	32

Content	Page
4-33.Setting Date and Time.....	32
4-34.Auto Power Off.....	33
4-35.Setting Format.....	33
4-36.Li-ion Battery Charge.....	33
4-37.Replacing the Batteries.....	34
4-38.Replacing the Fuses.....	34
5.Specifications.....	35
5-1.Technical Specifications.....	35
5-2.General Specification.....	38
Part 2.Operating Instruction for Oscilloscope Section.....	39
6.Summary.....	40
7.Features.....	40
8.General Safety Requirements.....	41
9.Introduction.....	42
9-1.General Knowledge of Front Panel.....	42
9-2.User Interface of Digital Oscilloscope.....	43
9-3.Brief Function Examination.....	43
9-4.Probe and Connector.....	44
10.Function and Operation.....	45
10-1.Interface and Buttons.....	45
10-2.Connector.....	45
10-3.Help Section.....	46
10-4.System Settings.....	46
10-5.Fast/Slow Display.....	47
10-6.Vertical System.....	47
10-7.Horizontal System.....	47
10-8.Trigger System.....	47
10-9.Trigger Mode.....	47
10-10.Channel.....	48
10-11.FFT Frequency Spectrum Analysis.....	48
10-12.Signal Capture System.....	50
10-13.Display System.....	50
10-14.Measuring System.....	51
10-15.Cursor Data Measurement.....	52
10-16.Waveform Records.....	53
10-17.Memory System.....	53
11.Examples.....	55
11-1.Simple Measurement.....	55
11-2.Cursor Measurement.....	55
11-3.Serial Signal Measurement.....	55
11-4.Analyze AC Signal by FFT.....	56
11-5.Waveform Save.....	56
12.Fault Processing.....	57
13.Daily Maintenance.....	58
14.Specifications.....	59
Part 3.Operating Instruction for Meterbox.....	61

Part 1

Operating Instruction for True RMS Multimeter





1.Introduction

- The Professional True RMS Industrial Digital Multimeter with oscilloscope functions and TFT color LCD display, providing fast A/D converting sampling time, high accuracy, built-in datalogging and Trend Capture features.
- It can trace any interrupted problems of the equipments and watch on without person.
- It is easy to find and solve the problems of the production equipments, providing Bluetooth technology and memory the datasheets.
- It is much more safe measurements with double molded plastic housing design and IP67 waterproof function.
- This meter measures AC/DC Voltage, AC/DC Current, Resistance, Capacitance, Frequency (Electrical & Electronic), Duty Cycle, Diode Test, Insulation Test and Continuity plus Thermocouple Temperature.
- It can store and recall data.
- It features a waterproof, rugged design for heavy duty use.
- Proper use and care of this meter will provide many years of reliable service.

2.Safety


2-1.International Safety Symbols

 This symbol adjacent to another symbol, terminal or operating device indicates that the operator must refer to an explanation in the Operating Instructions to avoid personal injury or damage to the meter.

 This symbol adjacent to one or more terminals identifies them as being associated with ranges that may, in normal use, be subjected to particularly hazardous voltages. For maximum safety, the meter and its test leads should not be handled when these terminals are energized.

WARNING This **WARNING** symbol indicates a potentially hazardous situation, which if not avoided, could result in death or serious injury.

CAUTION This **CAUTION** symbol indicates a potentially hazardous situation, which if not avoided, may result damage to the product.

 **MAX** This symbol advises the user that the terminal (s) so marked must not be connected to a circuit point at which the voltage with respect to earth ground exceeds (in this case) 1000 VAC or VDC.

 This symbol indicates that a device is protected throughout by double insulation or reinforced insulation.

2-2.PER IEC1010 Overvoltage Installation Category

OVERVOLTAGE CATEGORY I

Equipment of Overvoltage Category I is equipment for connection to circuits in which measures are taken to limit the transient overvoltages to an appropriate low level.

Note: Examples include protected electronic circuits.

OVERVOLTAGE CATEGORY II

Equipment of Overvoltage Category II is energy-consuming equipment to be supplied from the fixed installation.

Note: Examples include household, office, and laboratory appliances.

OVERVOLTAGE CATEGORY III

Equipment of Overvoltage Category III is equipment in fixed installations.

Note: Examples include switches in the fixed installation and some equipment for industrial use with permanent connection to the fixed installation.

OVERVOLTAGE CATEGORY IV

Equipment of Overvoltage Category IV is for use at the origin of the installation.

Note: Examples include electricity meters and primary over-current protection equipment

2-3.Safety Instructions

This meter has been designed for safe use, but must be operated with caution, the rules listed below must be carefully followed for safe operation.

- Never apply voltage or current to the meter that exceeds the specified maximum:
- Use extreme CAUTION when working with high voltages.
- Do not measure voltage if the voltage on the "COM" input jack exceeds 1000V above earth ground.
- Never connect the meter leads across a voltage source while the function switch is in the current, resistance or diode mode, doing so can damage the meter.
- Always discharge filter capacitors in power supplies and disconnect the power when making resistance or diode tests.
- Always turn off the power and disconnect the test leads before opening the covers to replace the fuse or batteries.
- Never operate the meter unless the back cover and the battery and fuse covers are in place and fastened securely.
- If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

2-4. Input Limits

Function	Maximum Input
V DC or V AC	1000VDC/AC RMS
mA AC/DC	800mA 1000V fast acting fuse
A AC/DC	10A 1000V fast acting fuse (20A for 30 seconds max every 15 minutes)
Frequency, Resistance, Capacitance, Duty Cycle, Diode Test, Continuity	1000VDC/AC rms
Temperature	1000VDC/AC rms
Surge Protection: 8kV peak per IEC 61010	

2-5. FCC Compliance Statement

- This device complies with part 15 of the FCC Rules.
 - Operation is subject to the following two conditions:
 1. This device may not cause harmful interference, and
 2. This device must accept any interference received, including interference that may cause undesired operation.
- Note:** This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications.
- However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:
 - Reorient or relocate the receiving antenna.
 - Increase the separation between the equipment and receiver.
 - Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
 - Consult the dealer or an experienced radio/TV technician for help.

WARNING: Changes or modifications to this unit not expressly approved by the part responsible for compliance could void the user's authority to operate the equipment.



FCC Radiation Exposure Statement:

- The device has been evaluated to meet general RF exposure requirement.
- The device can be used in portable exposure condition without restriction.


3.Description

3-1.Meter Description

- 1-LCD Display
- 2-F1 Function Button
- 3-F2 Function Button
- 4-F3 Function Button
- 5-F4 Function Button
- 6-HOLD Button
- 7-MAX/MIN Button
- 8-RANGE Button
- 9-ESC Button
- 10-Cursor Button (Up, Down, Left and Right)
- 11-Rotary Function Switch
- 12-10A Input Jack
- 13- μ A/mA Input Jack
- 14-Positive Input Jack
- 15-COM Input Jack
- 16-Lanyard Hole
- 17-Test Lead Holders
- 18-Tilt Stand
- 19-Battery Cover

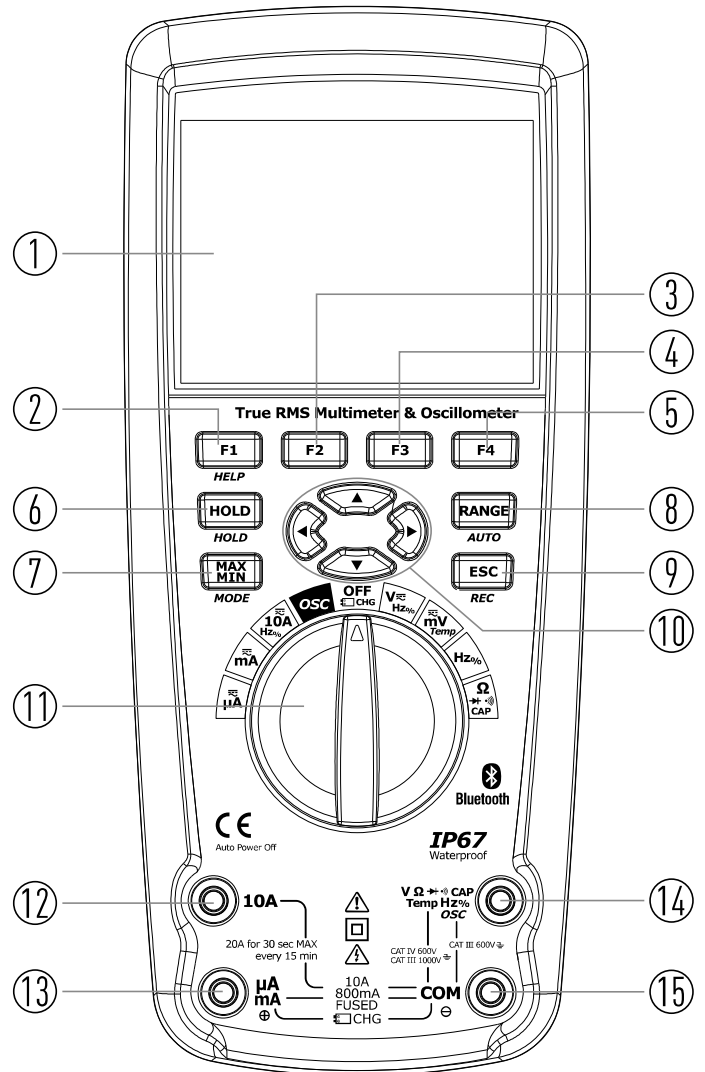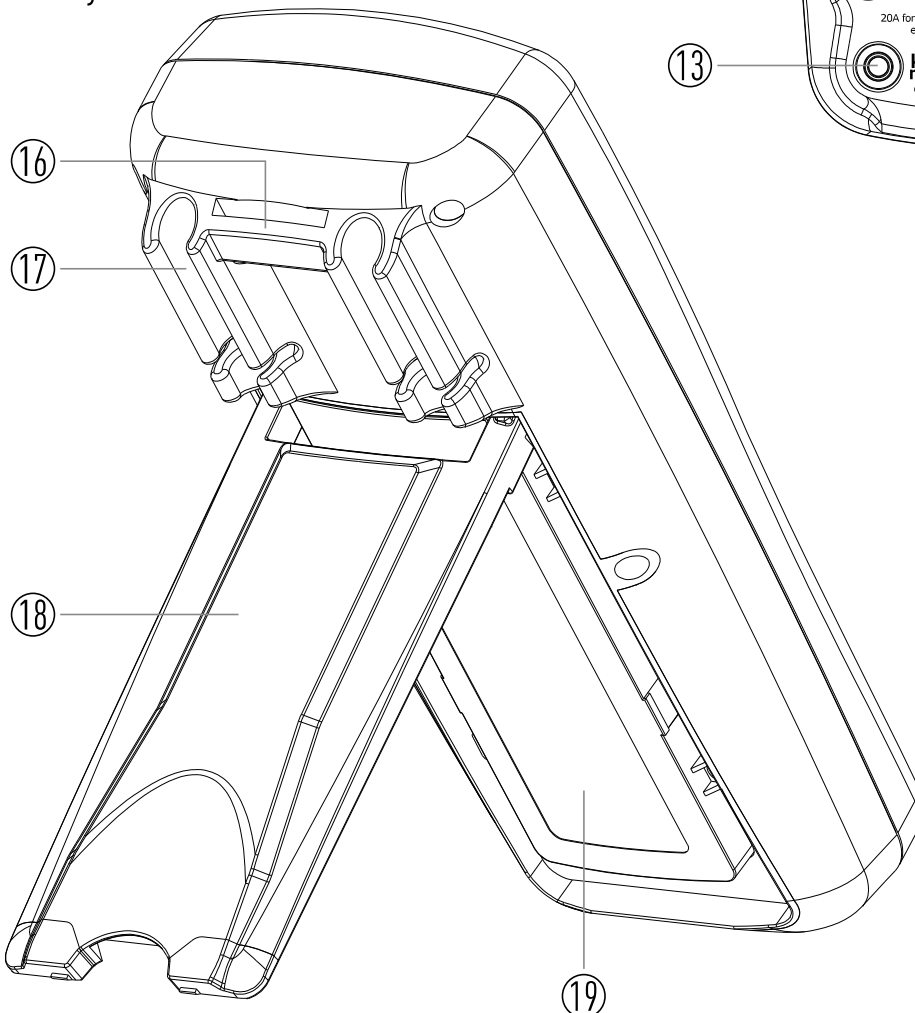


3-2. Understanding the Push Buttons

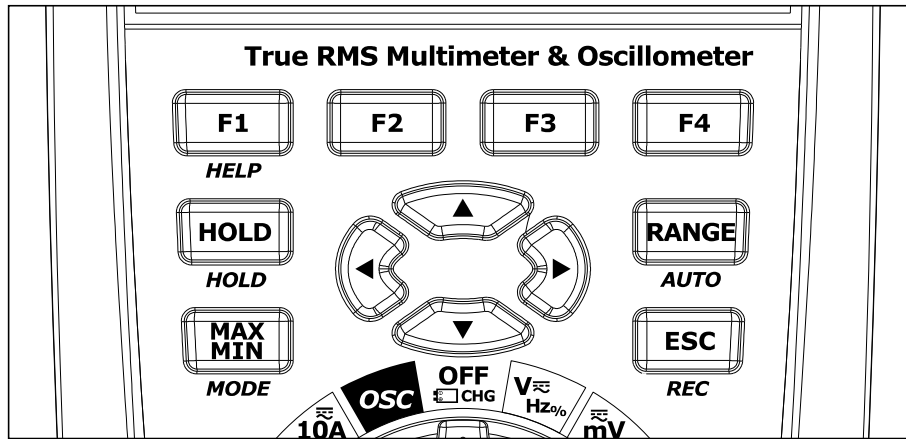

The 12 push buttons on the front of the Meter activate features that augment the function selected using the rotary switch, navigate menus or control power to Meter circuits.

- **F1/F2/F3/F4 Function Button:** Selects sub-functions and modes related to the rotary switch function.
- **Cursor Button:** Select an item in a menu, adjust display contrast, scroll through information and perform data entry.
- **HOLD Button:** Freezes the present reading in the display and allows the display to be saved, also accesses AutoHold.
- **RANGE Button:** switches the Meter range mode to manual and then cycles through all ranges, to return to auto ranging, press the button for 1 second.
- **MAX/MIN Button:** Starts and stops MIN MAX recording.
- **ESC Button:** Return from Power off.


3-3. Understanding the Rotary Switch

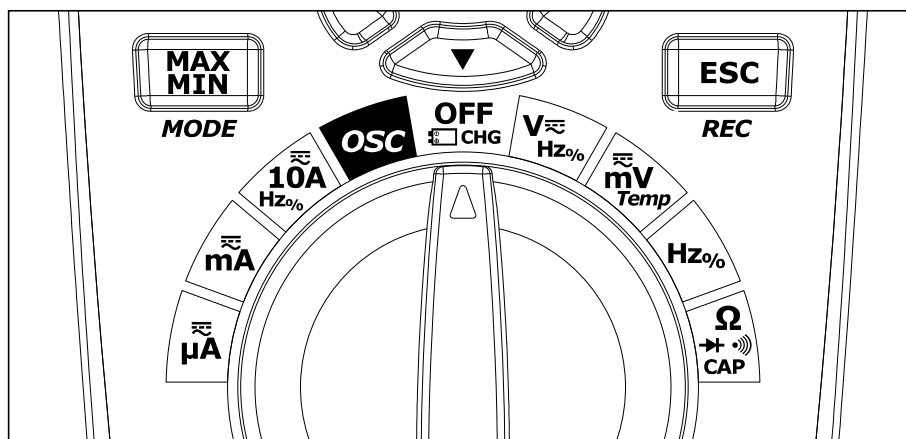

- Select a primary measurement function by positioning the rotary switch to one of the icons around its perimeter.
- For each function, the Meter presents a standard display for that function (range, measurement units, and modifiers).
- Button choices made in one function do not carry over into another function.

V~ Hz%	AC/DC and AC+DC Voltage Measurement
mV~ Temp	AC/DC and AC+DC Millivolt measurement Temperature Measurement
Hz%	Frequency Measurement
Ω →•• CAP	Resistance, Diode Test, Capacitance and Continuity Measurement
10A~	AC/DC and AC+DC Amps Measurement
mA~	AC/DC and AC+DC Milliamps Measurement
μA~	AC/DC and AC+DC Microampere Measurement up to 5,000μA


3-4.Using the Input Terminals

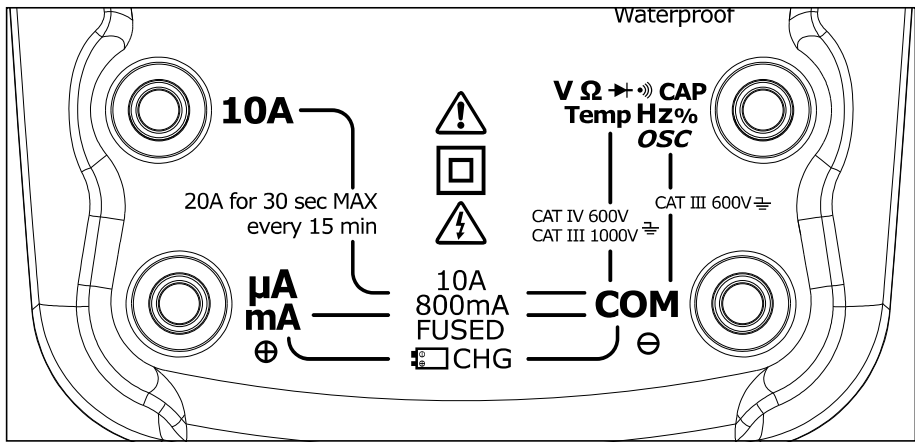

- All functions except current use the **Positive** and **COM** Input Jack.
- The two current input terminals (10A and mA/ μ A) are used as follows:
Current from 0 to 500mA, use the **μ A/mA** and **COM** Input Jack.
Current between 0 and 10A use the **10A** and **COM** Input Jack.

10A	Input for 0A to 10.00A current (20A overload for 30 seconds on, 10 minutes off).
μA mA	Input for 0A to 500mA current measurement.
COM	Return terminal for all measurement.
V Ω \rightarrow CAP Temp Hz%	Input for Voltage, Continuity, Resistance, Diode Test, Conductance, Capacitance.

3-5. Understanding the Display

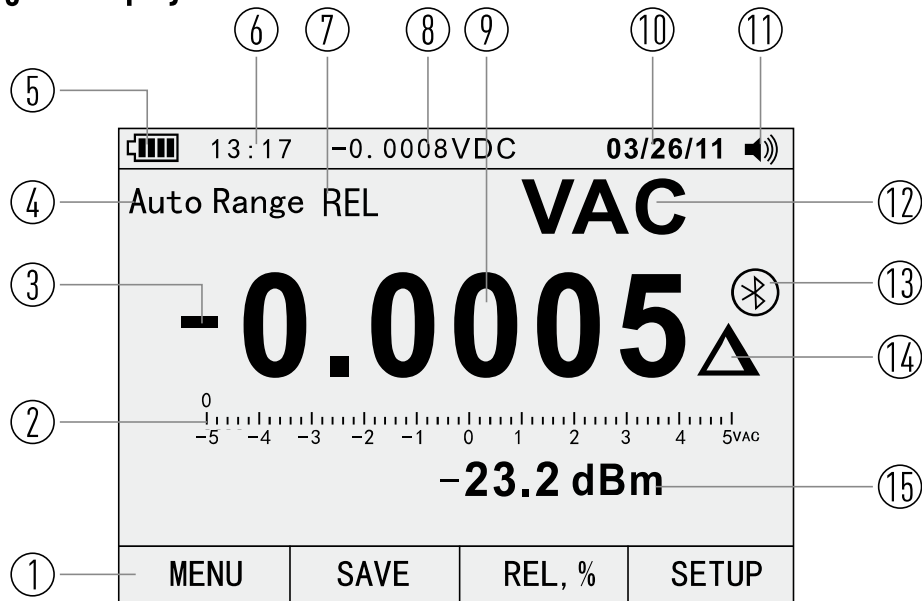

- 1-Soft key labels Indicates the function of the button just below the displayed label.
- 2-Bar graph Analog display of the input signal(See the "Bar Graph" section for more information).
- 3-Minus sign Indicates a negative reading.
- 4-Indicates the range the Meter is in and the ranging mode (auto or manual)
- 5-Battery level Indicates the charge level batteries.
- 6-Time Indicates the time set in the internal clock.
- 7-Mode annunciators Indicates the Meter's mode.
- 8-Minimeasurement Displays the lightning bolt (when necessary) and the input value when the primary and secondary displays are covered by a menu or pop-up message.
- 9-Main display Displays measurement information about the input signal.
- 10-Date Indicates the date set in the internal clock.
- 11-Beeper Indicates the Meter's beeper is enabled (not associated with the continuity beeper).
- 12-Units Indicates the units of measure, N Auxiliary Units Indicates unit less measurements like Crest Factor.
- 13-Blue tooth Indicates activity over the communication link.
- 14-Relative Indicates the displayed value is relative to a reference value.
- 15-Secondary display Displays secondary measurement information about the input signal.

3-6. Page Area

- The page area of the display is where the main meter content is displayed.
- The primary display (upper half of the page area) is where the most important value of the selected function is shown.
- The secondary display contains the bar graph and values that may be measured in addition to the primary function value, for example, with frequency measurement selected in VAC, the frequency value will appear in the primary display with the ac voltage value in the secondary display.

3-7. Softkey Labels


- Labels for the four function softkeys (F1 through F4) appear in the bottom row of the display.
- These labels will change based on the function and/or menu selection.

4. Measurement and Setup

4-1. DC Voltage Measurement

CAUTION: Do not measure DC voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.

1. Set the function switch to the **VDC** Position.
2. Insert the black test lead banana plug into the **COM** Input Jack; Insert the red test lead banana plug into the **Positive** Input Jack.
3. Read the voltage in the display.

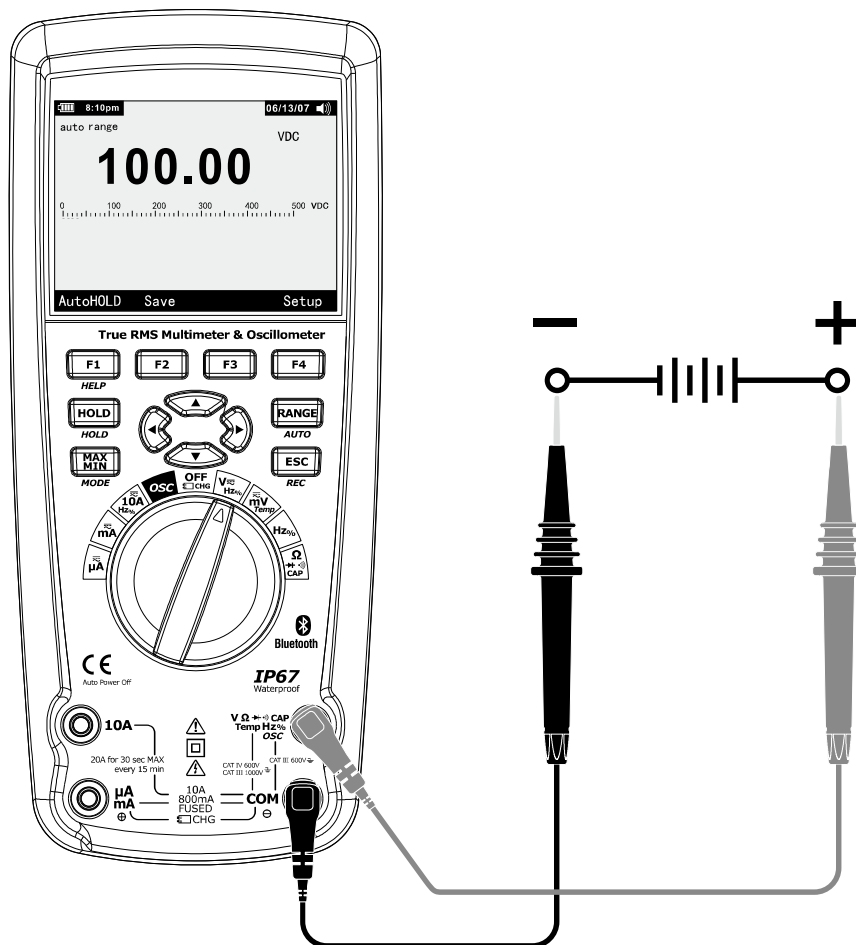


4-2.AC Voltage Measurement

WARNING: Risk of Electrocution. The probe tips may not be long enough to contact the live parts inside some 240V outlets for appliances because the contacts are recessed deep in the outlets. As a result, the reading may show 0 volts when the outlet actually has voltage on it. Make sure the probe tips are touching the metal contacts inside the outlet before assuming that no voltage is present.

CAUTION: Do not measure AC voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.

1. Set the function switch to the **VAC** Position.
2. Press the soft key labeled Menu, move the menu selector to the menu item labeled VAC, press the soft key VAC.
3. Insert the black test lead banana plug into the **COM** Input Jack; Insert the red test lead banana plug into the **Positive** Input Jack.
4. Read the voltage in the display.

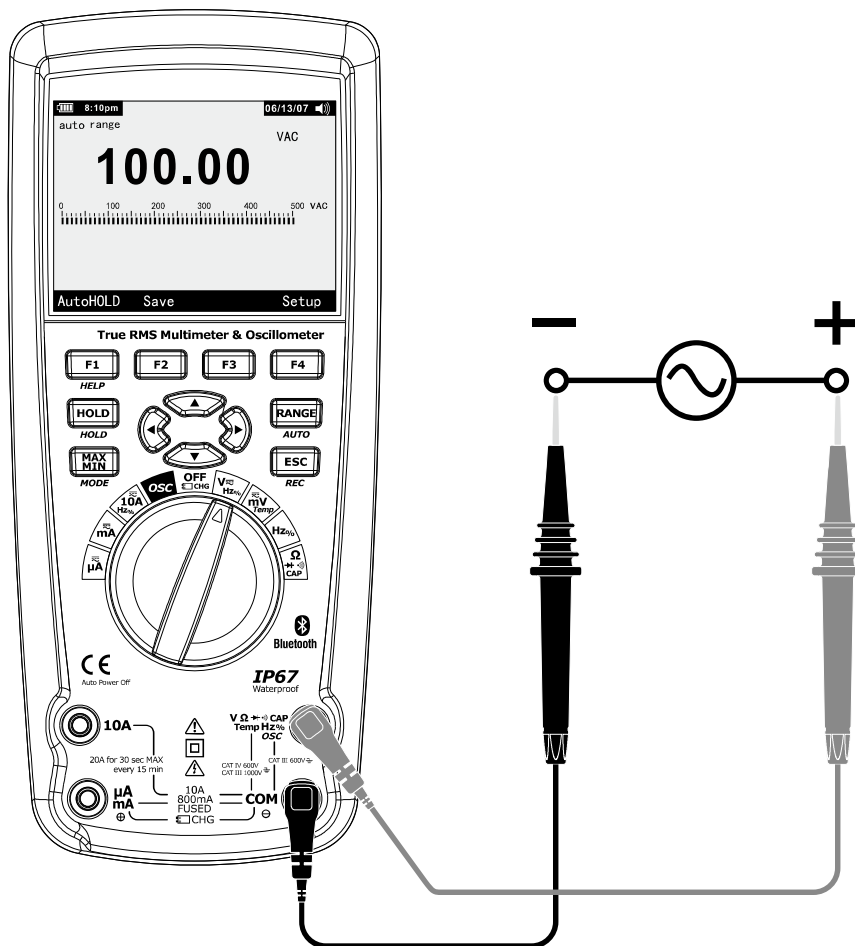

4-3. Making dB Measurement

The Meter is capable of displaying voltage as a dB value, either relative to 1 milliwatt (dBm), a reference voltage of 1 volt (dBV) or a user-selectable reference value.

1. Set the function switch to the **VAC** Position.
2. Press the softkey labeled Menu, move the menu selector to the menu item labeled dBm, press the softkey dBm.
3. Insert the black test lead banana plug into the **COM** Input Jack; Insert the red test lead banana plug into the **Positive** Input Jack.
4. Read the voltage in the main display and the dBm in the Secondary display.
5. To select another reference value, press the softkey labeled Ref to display a message box with the current reference value, pressing ▲ or ▼, scrolls through the nine predefined references: 4, 8, 16, 25, 32, 50, 75, 600 and 1000, set the reference by pressing the softkey labeled OK.



4-4. Low Pass Filter


- The Meter is equipped with an ac low pass filter.
- When measuring ac voltage, press the soft key labeled Menu to open the function menu, and move the menu selector to the LO item.
- Next, press the softkey labeled LO to toggle the low pass filter mode.



4-5.mV Voltage Measurement


CAUTION: Do not measure mV voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.

1. Set the function switch to the **mV** Position.
2. Press the soft key labeled Menu, move the menu selector to the menu item labeled mVDC(mVAC), press the soft key mVDC(mVAC).
3. Insert the black test lead banana plug into the **COM** Input Jack; Insert the red test lead banana plug into the **Positive** Input Jack.
4. Read the mV voltage in the display.

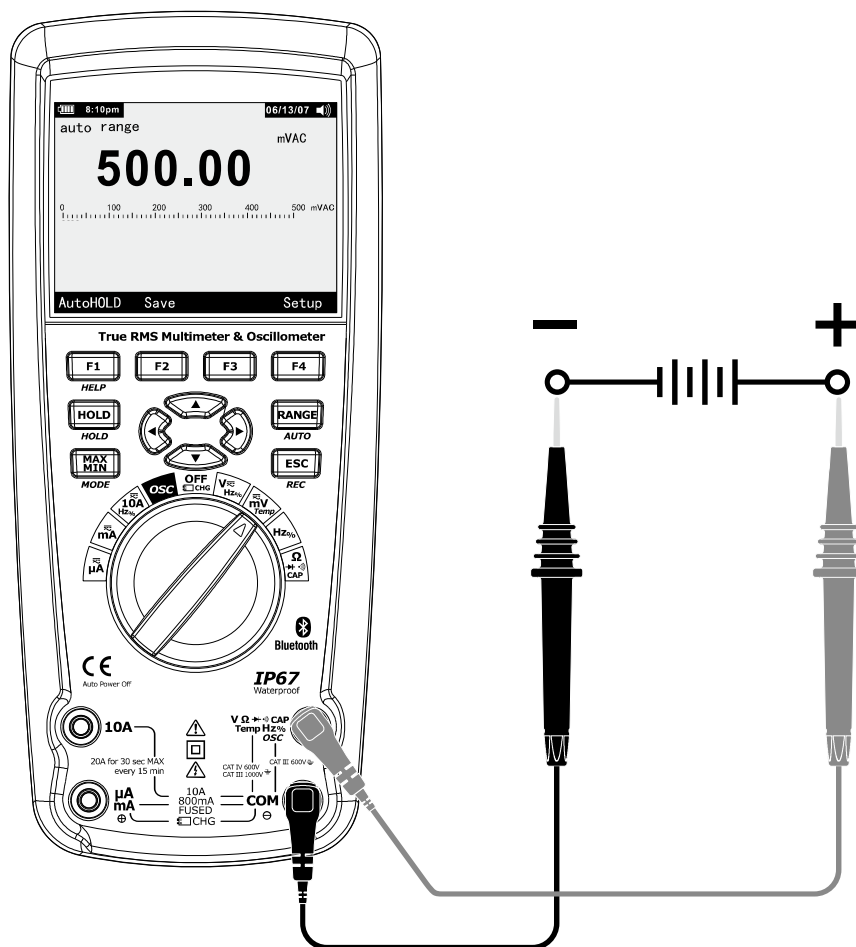


4-6. Temperature Measurement

1. Set the function switch to the TEMP Position.
2. Press the soft key labeled Menu, move the menu selector to the menu item labeled TEMP, press the soft key TEMP (°C or °F).
3. Insert the Temperature Probe into the input jacks, making sure to observe the correct polarity.
4. Read the temperature in the display.
5. To input a temperature offset value, press the softkey labeled Offset to open a message box with the present offset value.
 - Use ◀ and ▶ to position the cursor over one of the digits or the polarity sign.
 - Use ▲ and ▼ to scroll through the numbers for each digit in the offset or switch between a + or - offset.
 - With the desired value displayed, press the softkey labeled OK to set the temperature offset.

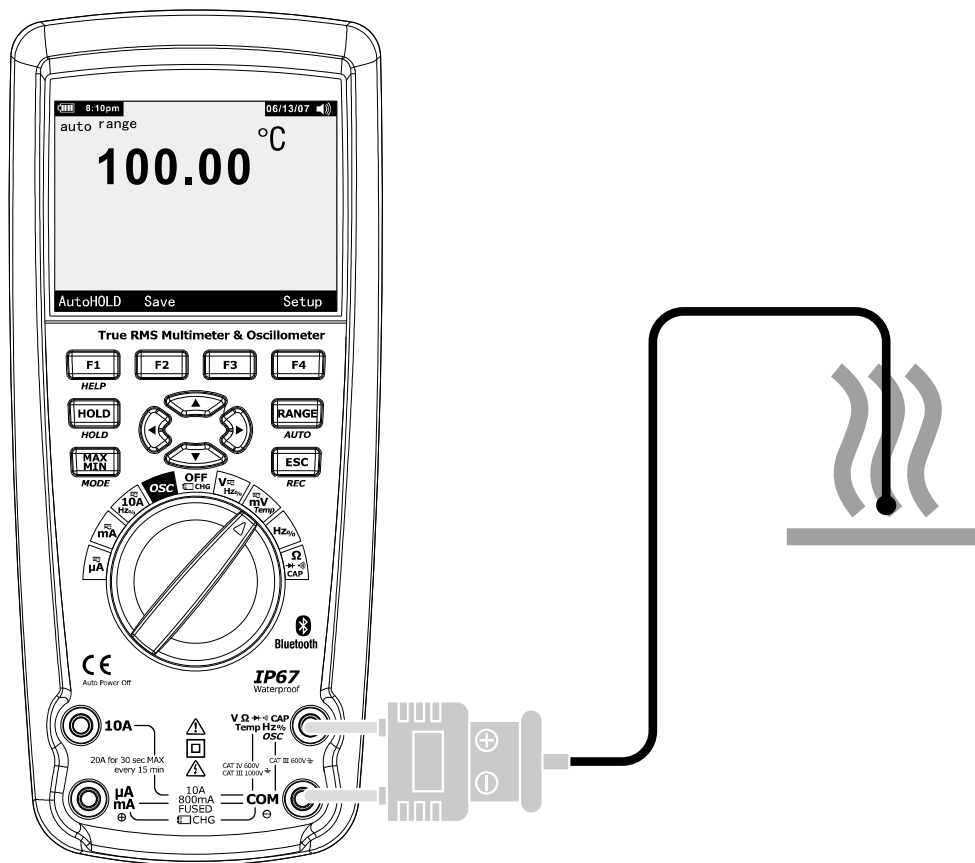

4-7. Frequency Measurement


1. Set the function switch to the **Hz%** Position.
2. Insert the black test lead banana plug into the **COM** Input Jack; Insert the red test lead banana plug into the **Positive** Input Jack.
3. Read the Frequency in the display.

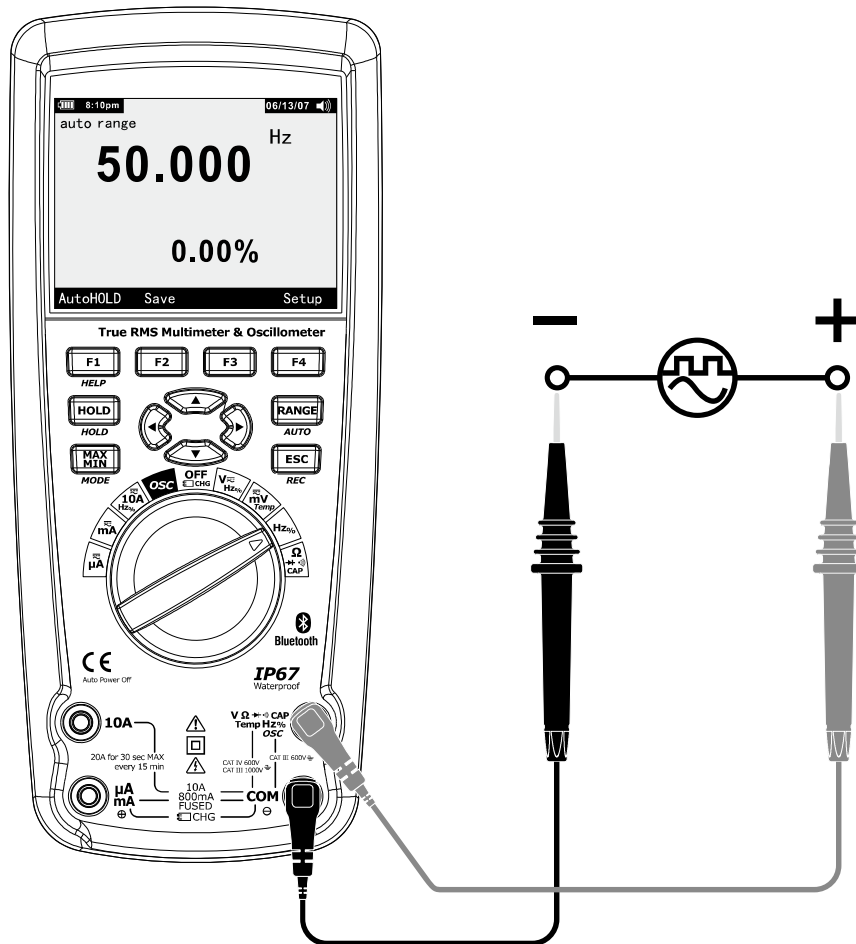

4-8. Resistance Measurement

WARNING: To avoid electric shock, disconnect power to the unit under test and discharge all capacitors before taking any resistance measurements. Remove the batteries and unplug the line cords.


1. Set the function switch to the $\Omega \cdot \text{CAP} \rightarrow$ CAP Position.
2. Insert the black test lead banana plug into the **COM** Input Jack; Insert the red test lead banana plug into the **Positive** Input Jack.
3. Read the resistance in the display.

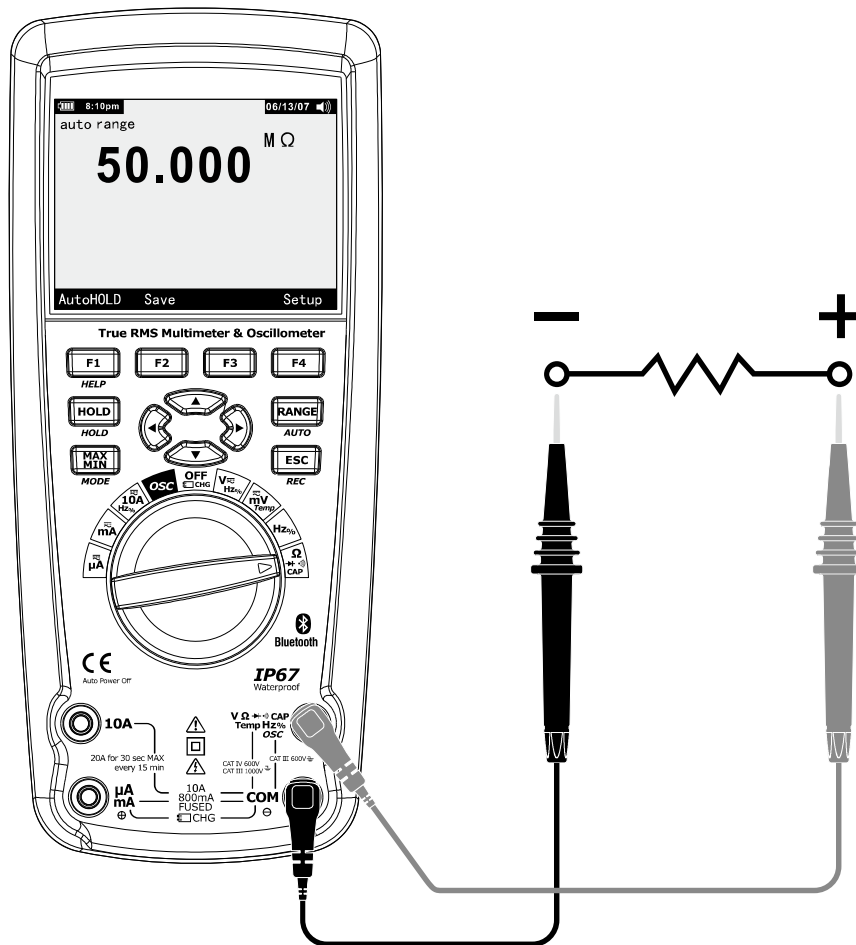

4-9. Continuity Check


WARNING: To avoid electric shock, disconnect power to the unit under test and discharge all capacitors before taking any resistance measurements. Remove the batteries and unplug the line cords.

1. Set the function switch to the Ω \rightarrow CAP Position.
2. Press the soft key labeled Menu, move the menu selector to the menu item labeled Beeper, press the soft key Beeper.
3. Insert the black test lead banana plug into the **COM** Input Jack; Insert the red test lead banana plug into the **Positive** Input Jack.
4. If the resistance is less than approximately $25\ \Omega$, the audible signal will sound; If the circuit is open, the display will indicate "OL".

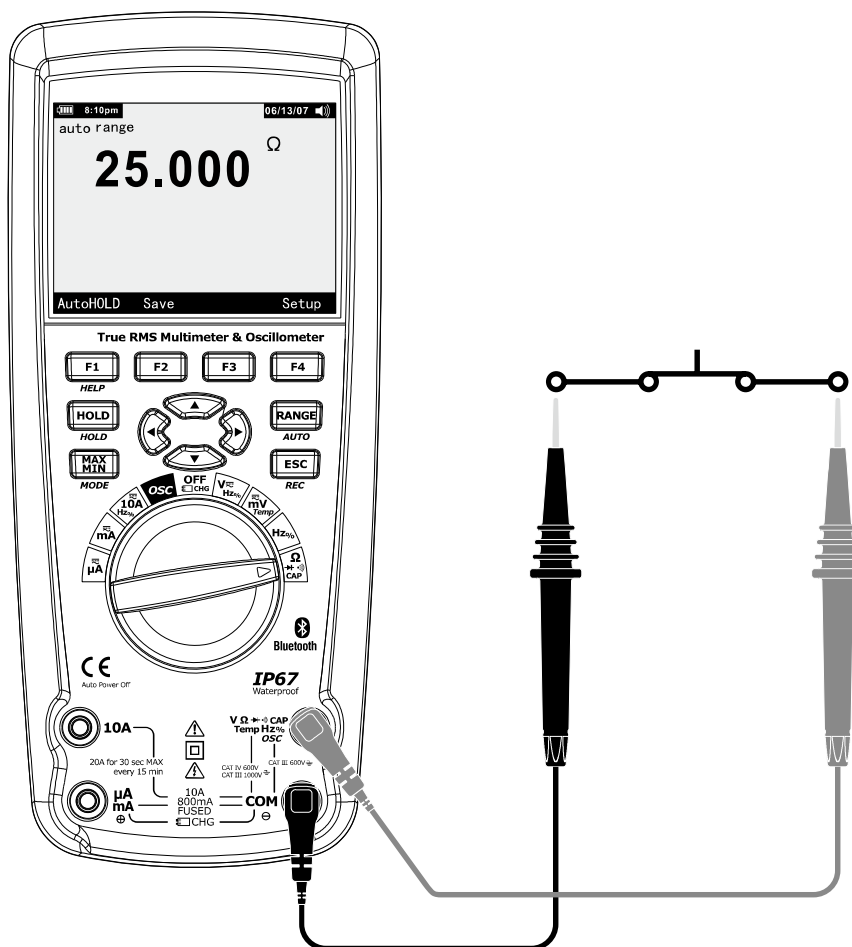

4-10. Diode Test


1. Set the function switch to the $\Omega \rightarrow \rightarrow \rightarrow$ CAP Position.
2. Press the soft key labeled Menu, move the menu selector to the menu item labeled Diode, press the soft key Diode.
3. Insert the black test lead banana plug into the **COM** Input Jack; Insert the red test lead banana plug into the **Positive** Input Jack.
4. Forward voltage will typically indicate 0.400 to 3.200V; Reverse voltage will indicate "OL"; Shorted devices will indicate near 0V and an open device will indicate "OL" in both polarities.

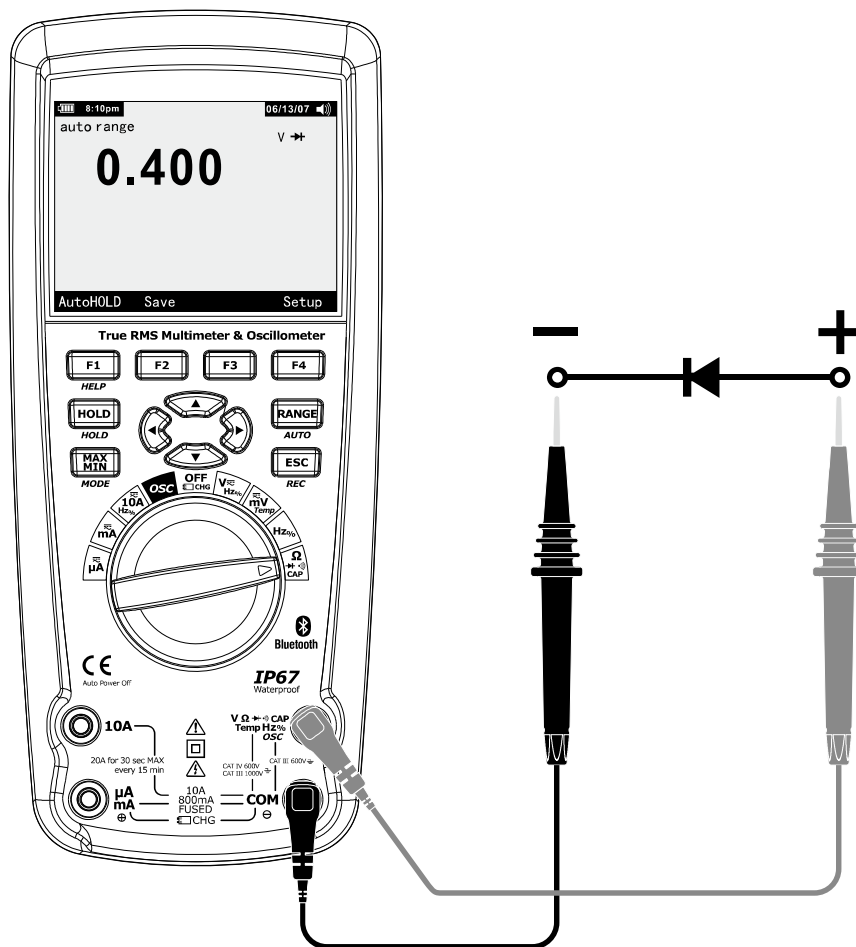

4-11.Capacitance Measurement

WARNING: To avoid electric shock, disconnect power to the unit under test and discharge all capacitors before taking any capacitance measurements. Remove the batteries and unplug the line cords.


- 1.Set the function switch to the $\Omega \cdot \text{CAP}$ Position.
- 2.Press the soft key labeled Menu, move the menu selector to the menu item labeled Cap, press the soft key Cap.
- 3.Insert the black test lead banana plug into the **COM** Input Jack; Insert the red test lead banana plug into the **Positive** Input Jack.
- 4.Forward voltage will typically indicate 0.400 to 3.200V; Reverse voltage will indicate "OL"; Shorted devices will indicate near 0V and an open device will indicate "OL" in both polarities.

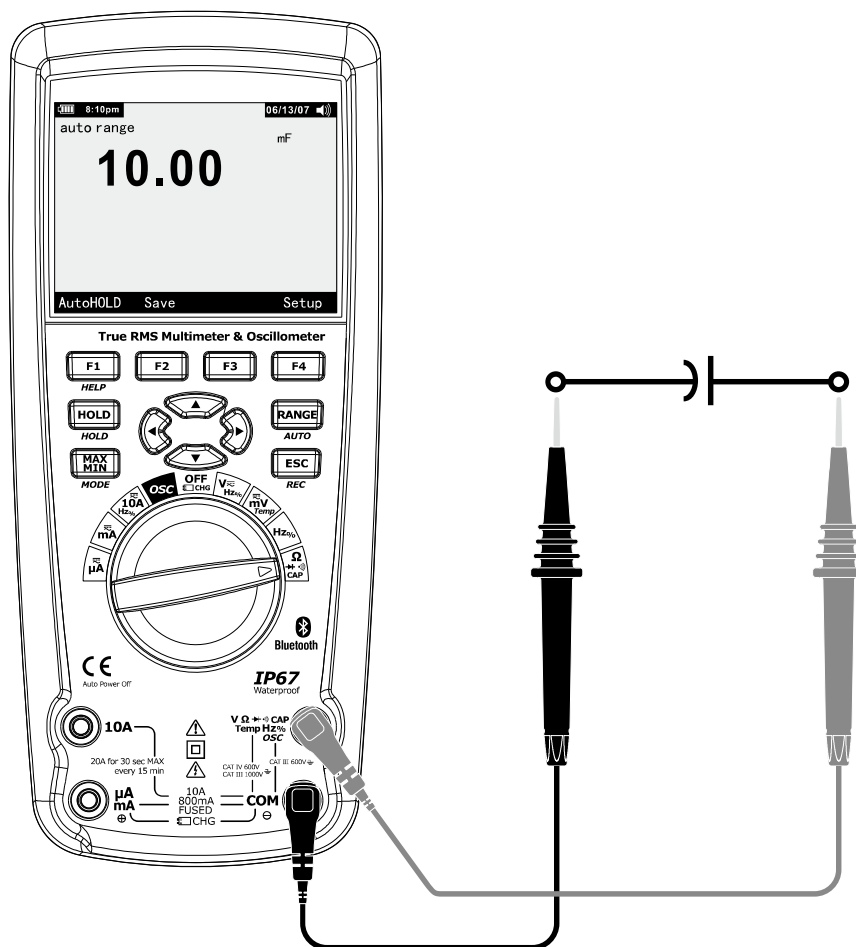

4-12.DC Current Measurement

CAUTION: Do not make 20A current measurements for longer than 30 seconds. Exceeding 30 seconds may cause damage to the meter and/or the test leads.


1. Insert the black test lead banana plug into the **COM** Input Jack.
2. For current measurements up to **5000 μ A DC**, set the function switch to the **μ A** Position and insert the red test lead banana plug into the **μ A/mA** Input Jack.
3. For current measurements up to **500mA DC**, set the function switch to the **mA** Position and insert the red test lead banana plug into the **μ A/mA** Input Jack.
4. For current measurements up to **10A DC**, set the function switch to the **10A** Position and insert the red test lead banana plug into the **10A** Input Jack.
5. Press the **MODE** Button to indicate **DC** on the display.
6. Read the current in the display.

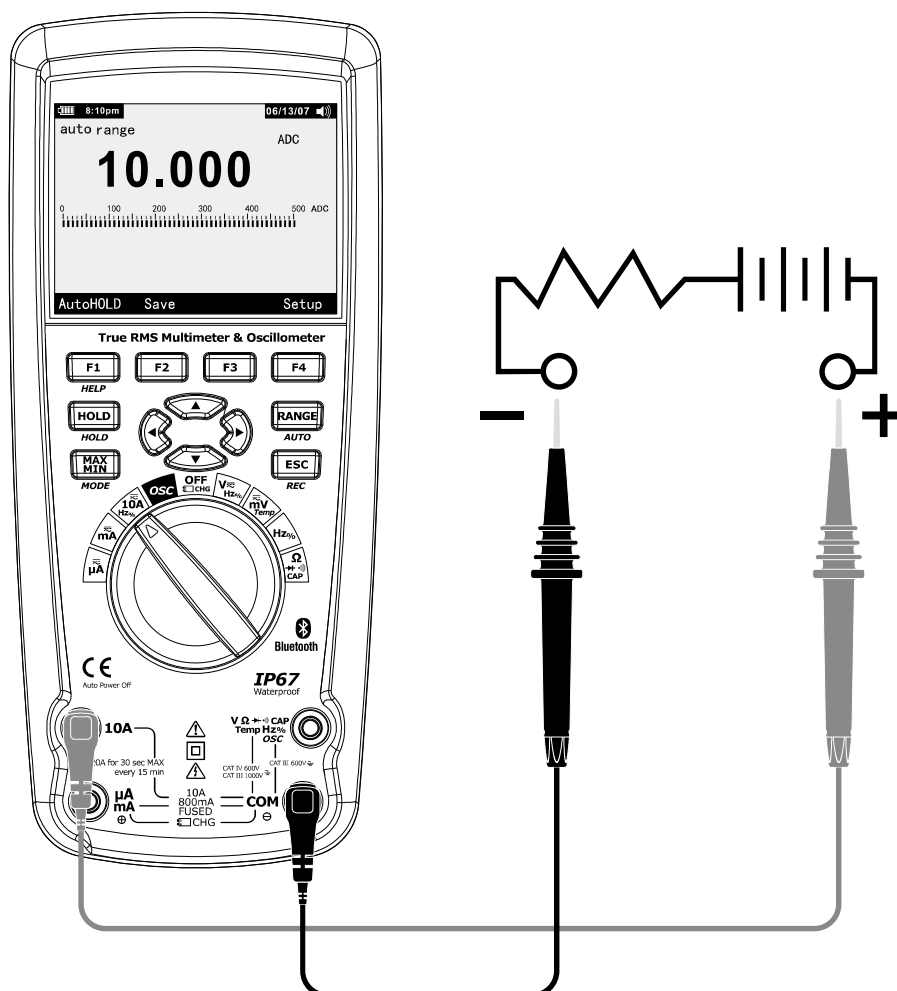

4-13.AC Current Measurement


CAUTION: Do not make 10A current measurements for longer than 30 seconds. Exceeding 30 seconds may cause damage to the meter and/or the test leads.

1. Insert the black test lead banana plug into the **COM** Input Jack.
2. For current measurements up to **5000 μ A AC**, set the function switch to the **μ A** Position and insert the red test lead banana plug into the **μ A/mA** Input Jack.
3. For current measurements up to **500mA AC**, set the function switch to the **mA** Position and insert the red test lead banana plug into the **μ A/mA** Input Jack.
4. For current measurements up to **10A AC**, set the function switch to the **10A** Position and insert the red test lead banana plug into the **10A** Input Jack.
5. Press the soft key labeled Menu, move the menu selector to the menu item labeled AC, press the soft key AC.
6. Read the current in the display.

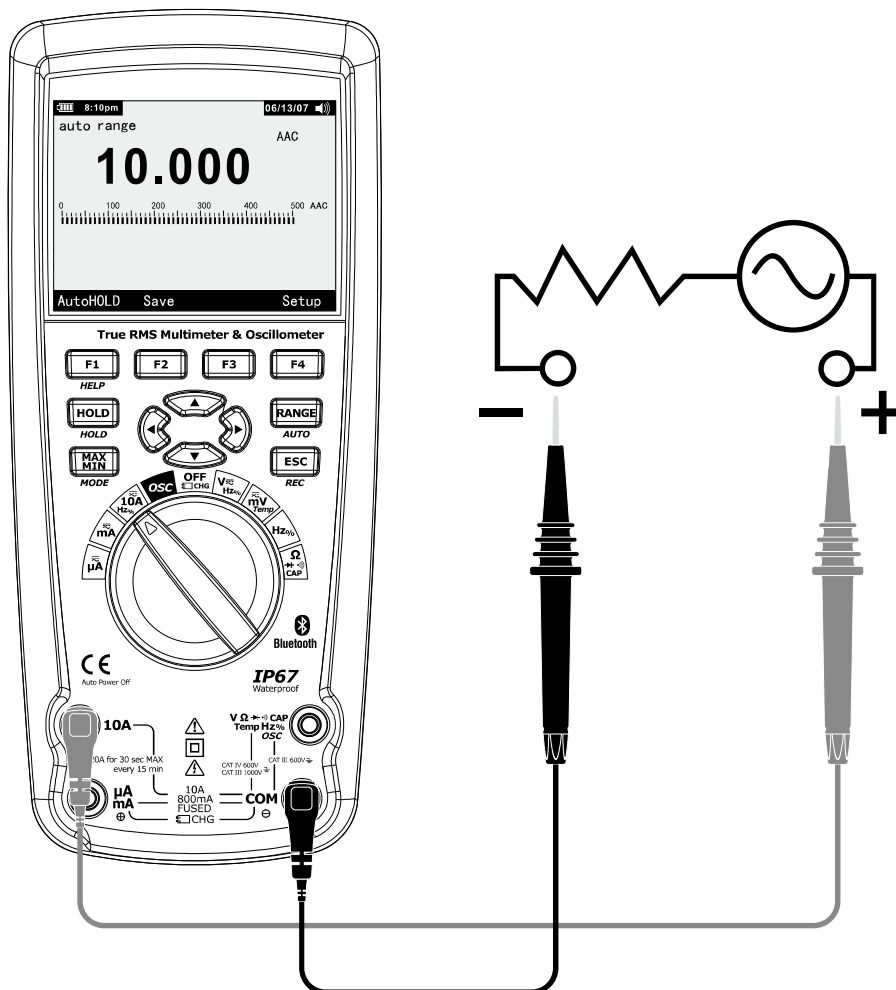

4-14. Understanding Function Menus

- Each primary measurement function (rotary switch position) has a number of optional sub-functions or modes accessed by pressing the softkey labeled Menu (F1).
- A typical menu is shown in Figure.

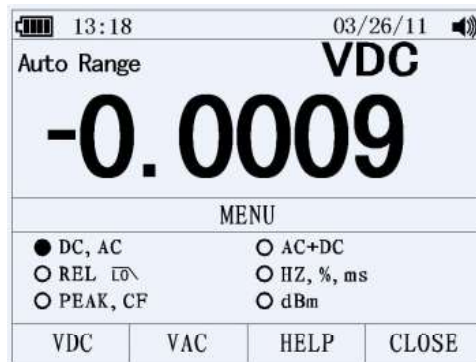


- Menu selection is indicated by the filled-in black square (hereafter the menu selector) to the left of a menu item.
- Use the four front-panel cursor buttons (▲ ▼ ◀ ▶) to position the menu selector next to a menu item.
- As the menu selector moves between menu items, the four softkeys and their labels change to reflect the available functions and/or modes available for the selection menu item.

4-15. Using Help

- While operating the Meter, more information about a selected function, a front-panel button, or a menu item may be necessary.
- Press soft key HELP to open an information window that lists topics covering the functions and modifiers that are available at the time the button is pressed.
- Each topic provides a brief explanation on a Meter function or feature.
- The number of information topics displayed at any one time may exceed the display area.
- Use the softkeys labeled Next and Prev to move from topic to topic.
- Use the softkey labeled More or ▲ and ▼ to scroll through the information a full screen at a time.

4-16. Measuring AC and DC Signals

- The Meter is capable of displaying both AC and DC signal components (Voltage or Current) as two separate readings or one AC+DC (RMS) value combined.
- As shown in Figure , the Meter displays ac and dc combinations two ways: DC displayed over AC (DC, AC) and AC combined with DC (AC+DC).
- Select one of these three displays using the Function and Mode menu.
- With the rotary switch set to V, mV, A, mA or μ A press the soft key labeled Menu.
- Move the menu selector to the menu item labeled AC+DC, at this point, three different soft key labels indicate AC+DC (F1) and DC,AC (F2), press the soft key that presents these two signals as needed.
- While in any of the three AC+DC modes, peak measurements, frequency, duty cycle, relative %, and period measurements are not allowed.
- In addition to these modes, MIN MAX, relative.

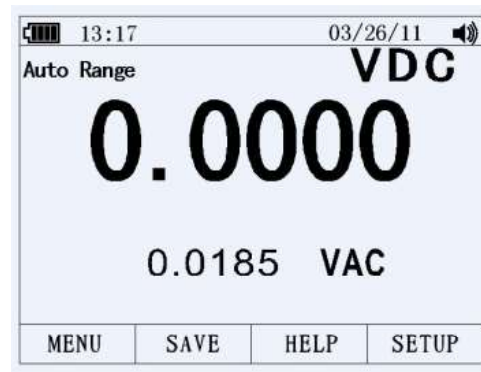

4-17. Capturing Minimum and Maximum Values


- The MAX MIN Record mode captures minimum, average, and maximum input values.
- When the input goes below the recorded minimum value or above the recorded maximum value, the Meter beeps and records the new value.
- The Meter stores the elapsed time since the recording session was started at the same time.
- The MAX MIN mode also calculates an average of all readings taken since the MAX MIN mode was activated.
- This mode is for capturing intermittent readings, recording minimum and maximum readings unattended or recording readings while equipment operation precludes watching the Meter.
- The MIN MAX mode is best for recording power supply surges, inrush currents, and finding intermittent failures.
- Response time is the length of time an input must stay at a new value to be captured as a possible new minimum or maximum value.
- To activate the MAX MIN mode, press MAX MIN.
- As shown in Figure, the Meter displays e at the top of the measurement page, and the MAX MIN start date and time along the bottom of the page.



- In addition, the recorded maximum, average, and minimum values appear in the secondary display with their respective elapsed times.
- To stop a MIN MAX recording session, press the softkey labeled Stop.
- The summary information in the display freezes, and the softkeys change function to allow saving the collected data.
- Pressing the softkey labeled Close exits the MIN MAX record session without saving the collected data.
- To save the MIN MAX screen data, the MIN MAX session must be ended by pressing the softkey labeled Stop.
- Next, press the softkey labeled Save, dialog box opens where the default saved name can be selected or another name assigned, the softkey labeled Save to store.
- Pressing the softkey labeled Restart while MIN MAX is running stops the MIN MAX session, discards all MIN MAX data, and immediately starts a new MIN MAX recording session.

4-18. Capturing Peak Values

- To activate the peak mode, press the softkey labeled Menu.
- Move the menu selector next to the menu item labeled Peak, CF or Peak.
- Press the softkey labeled Peak to start the peak recording session.

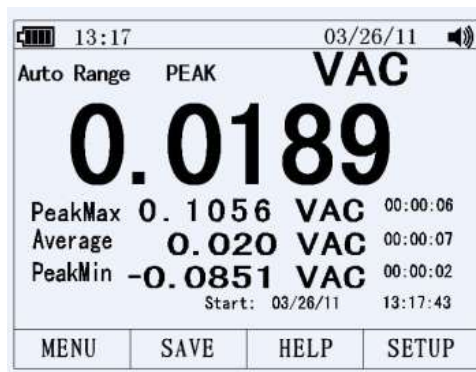


4-19. Relative Values

- To activate the peak mode, press the softkey labeled Menu.
- Move the menu selector next to the menu item labeled REL or Peak.
- Press the softkey labeled REL to start the peak recording session.
- If the Meter is already in the relative function, pressing Rel% causes the Meter to turn off relative and display relative percent.


4-20. Low Pass Filter

- The Meter is equipped with an ac low pass filter.
- When measuring AC voltage, press the softkey labeled Menu to open the function menu, and move the menu selector to the LO item.
- Next, press the softkey labeled LO to toggle the low pass filter mode.

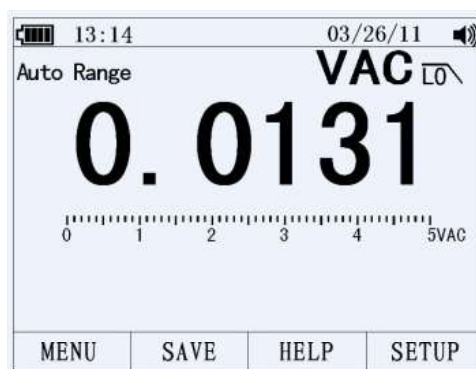


4-21. Hold and AutoHold Mode

- To freeze the display for any function, press key HOLD.
- Pressing the softkey labeled AutoHOLD activates AutoHold if the Meter is not in the Peak, MIN MAX, or Record modes.
- AutoHold operation monitors the input signal and updates the display and, if enabled, sounds the beeper, whenever a new stable measurement is detected.
- A stable measurement is one that does not vary more than a selected adjustable percentage (AutoHold threshold) for at least one second.
- The Meter filters out open lead conditions so the Meter leads can be moved between test points without triggering a display update.

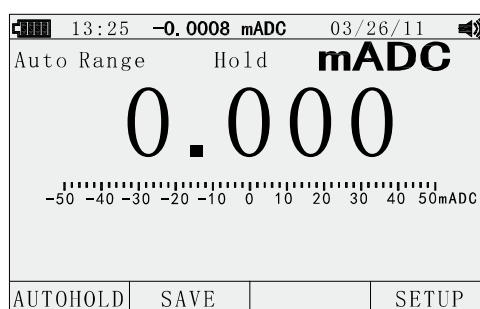

4-22. Storing Individual Measurement Data

- For all measurement functions, a snapshot of the screen data is saved by pressing the softkey labeled Save.
- Edit name, then pressing the softkey labeled Save stored date.


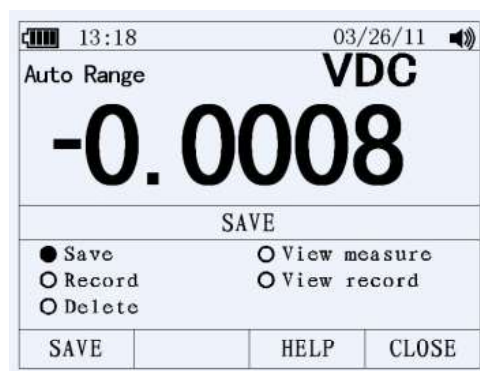


4-23. Viewing Memory Data

- Viewing data stored in the Meter's memory is performed through the save menu.
- Press the softkey labeled Save, position the menu selector next to the menu item labeled View measure and press the softkey labeled View.
- If there are previously stored records, press the softkey labeled Prev to page back through previously stored records, press the softkey labeled Next to page in the other direction, press the softkey labeled Delete to delete stored records.
- Press Close to return to normal Meter operation.


4-24. Viewing Trend Data

- Viewing data stored in the Meter's memory is performed through the save menu.
- Press the softkey labeled Save, position the menu selector next to the menu item labeled View record and press the softkey labeled View.
- If there are previously stored records, press the softkey labeled Prev to page back through previously stored records, press the softkey labeled Next to page in the other direction.
- Press Close to return to normal Meter operation.
- Press the soft key labeled Trend to display the recorded data in a trend-plot view.
- Press the softkey labeled Delete recorded data.

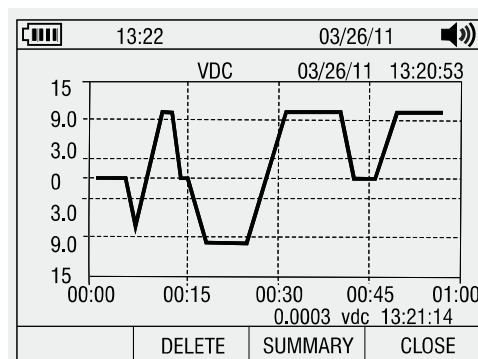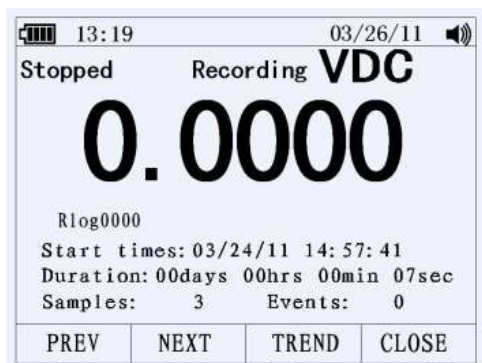

4-25. Recording Measurement Data

- The Meter's record feature collects measurement information over a user-specified duration.
- This collection of information is called a recording session.
- A recording session is made up of one or more measurement records. Each record contains measurement summary information covering the duration of the record.
- Press the softkey labeled Save, position the menu selector next to the menu item labeled Record and press the softkey labeled Record to open the configuration display.

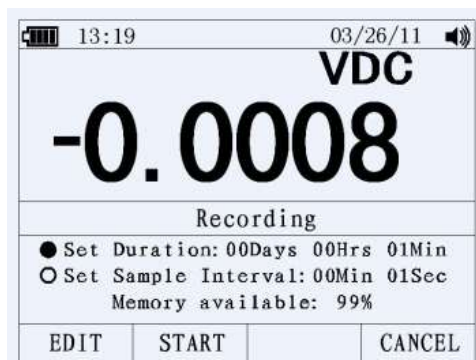

- Recording session duration and sample interval duration, both variables affect the recording length and number of intervals recorded.
- These two variables may interact, in that setting one variable may adjust the other variable to fit the recording session within the available memory.
- The percentage of memory available at the beginning of a recording session is displayed below the duration and sample interval settings.
- To change either of the two recording variables, use the cursor buttons to position the menu selector next to the desired menu item and press the softkey labeled Edit.


- Use ▲ ▼ ◀ ▶ to move between and set each digit of the selected variable.
- Press the softkey labeled Start to start records.
- The recording session will continue until the allocated memory is used, the batteries expire, the rotary switch is moved or the session is terminated by pressing the softkey labeled Stop.

4-26.Zooming in on Trend Data

- While viewing trend data, pressing or zooms in or out respectively on the data around the cursor.
- Each press of reduces the x-axis time period by one half to reveal more details.
- Each press of doubles the time period until all the recorded data is displayed.
- The zoom level is displayed in the upper-right hand corner of the display.

4-27.Changing Meter Setup Options

- The Meter has a number of preset features such as date and time formats and battery save mode timeouts and the displayed language, these variables are referred to as Meter setup options.
- Many setup options affect general Meter operations and are active in all functions.
- Others are limited to one function or group of functions.
- Access to the setup options is always available through the softkey labeled Setup.
- Information about the Meter, such as serial number, model, for example is also accessed through the setup menu.

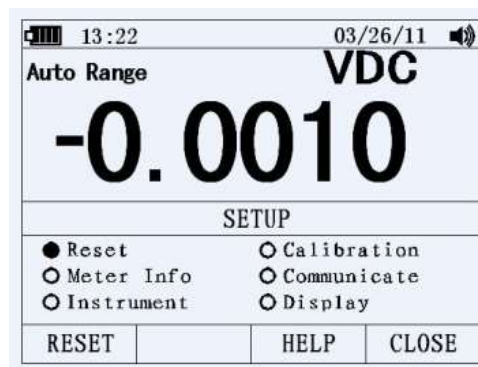

4-28.Resetting Meter Setup Options

- The Meter's setup options can be reset to default values through the setup menu.
- Open the setup menu by pressing the softkey labeled Setup, position the menu selector next to the menu item labeled Reset and press the softkey labeled Setup.
- A message will appear asking to confirm the reset action, press the softkey labeled OK to perform the reset.

4-29.Meter Info

- The Meter Info selection lists the serial number, model number, firmware version, calibration date and calibration counter.
- Operator name, company name are displayed.

4-30. Setting the Event Threshold Value

- Press the softkey labeled Setup to access the setup menu.
- Using the cursor buttons, move the menu selector next to the menu item labeled Instrument and press the softkey labeled Enter to open the recording setup screen.
- Using the cursor buttons, move the menu selector next to the menu item labeled Event Threshold for Recording (AutoHOLD) and then press the softkey labeled Edit.
- Press ▲ or ▼ to scroll through the event threshold values, with the desired value selected, press the softkey labeled Close.

4-31. Calibration

- The Calibration selection allows a qualified calibration technician to enter a password that allows the Meter to be calibrated.
- Press the softkey labeled Setup to access the setup menu.
- Using the cursor buttons, move the menu selector next to the menu item labeled Calibration and press the softkey labeled Calibrate, then input password, Enter Calibration menu.
- If change password, Press the softkey labeled Setup to access the setup menu.
- Using the cursor buttons, move the menu selector next to the menu item labeled Calibration and press the softkey labeled password, then input current password, Then input new password.

4-32. Using Communications

- You can use the Wireless communication link and transfer the contents of a meter's memory to a PC.
- Press the softkey labeled Setup to access the setup menu, using the cursor buttons, move the menu selector next to the menu item labeled communicate and press the softkey labeled ENTER.
- Press the softkey labeled OK will start communications function.

4-33. Setting Date and Time

- The Meter's internal clock is used in the display and for timestamping recorded measurements.
- To change the date and time as well as the display format, press the softkey labeled Setup, position the menu selector next to the menu item labeled Display.
- To set the date and time, press the softkey labeled Date/Time to open the date/time menu.
- Next, position the menu selector next to either the Set Date item or Set Time item and press the softkey labeled Edit.
- Using ◀ and ▶, position the cursor on the date or time element to adjust.
- Use ▲ and ▼ to change the selected date or time element value.
- Press OK to complete the action.

4-34.Auto Power Off


- Press the softkey labeled Setup, position the menu selector next to the menu item labeled Display.
- To set Auto Power Off and then press the softkey labeled Edit.
- Use ▲ and ▼ to adjust the time to one of the preset values 0 is disable the timeout feature, press the softkey labeled OK to set the selected time.
- Press the softkey labeled Close to return.

4-35.Setting Format

- Press the softkey labeled Setup, position the menu selector next to the menu item labeled Format.
- Using the cursor buttons, move the menu selector next to the menu item labeled Numeric(Date\Time) format, press the softkey labeled EDIT, select 0.0000 (0,0000) and MM/DD/YY (DD/MM/YY) and 24HOUR (12HOUR) format.


4-36.Li-ion Battery Charge

- 1.Set the function switch to the **OFF/CHG** Position.
- 2.Insert the socket into the Meter Input port and the Adapter connected to the switch socket, then Insert the adapter into power socket.
- 3.Display charge symbol in TFT color LCD display.

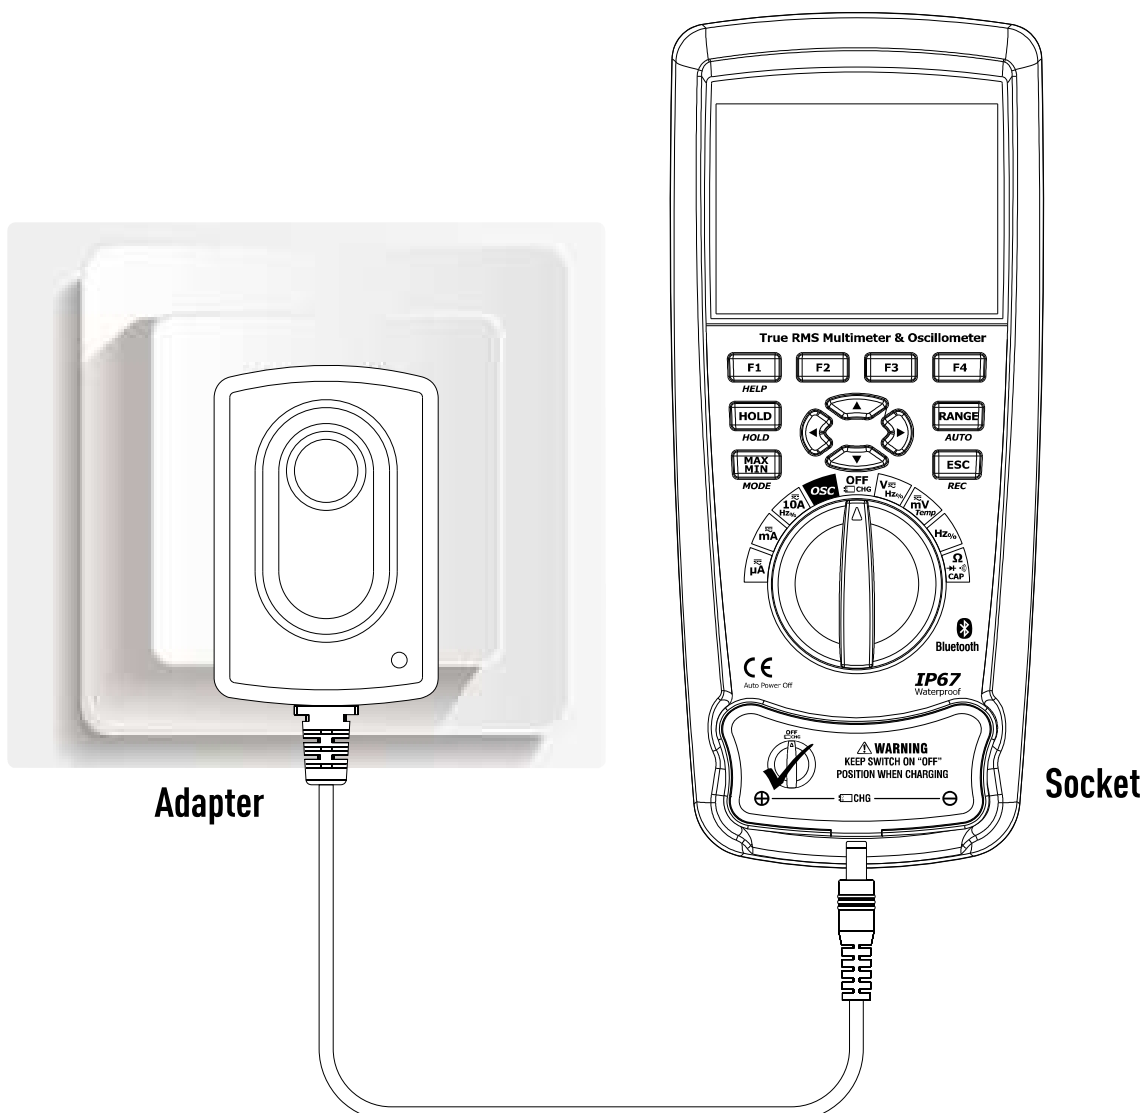


4-37.Replacing the Batteries

- 1.Turn the Meter off and remove the test leads from the terminals.
- 2.Remove the battery door assembly by using a standardblade screwdriver to turn the battery door screw one-half turn counterclockwise.
- 3.Replace the batteries with 7.4 volt charge batteries Observe proper polarity.
- 4.Reinstall the battery door assembly and secure it by turning the screw one-half turn clockwise.

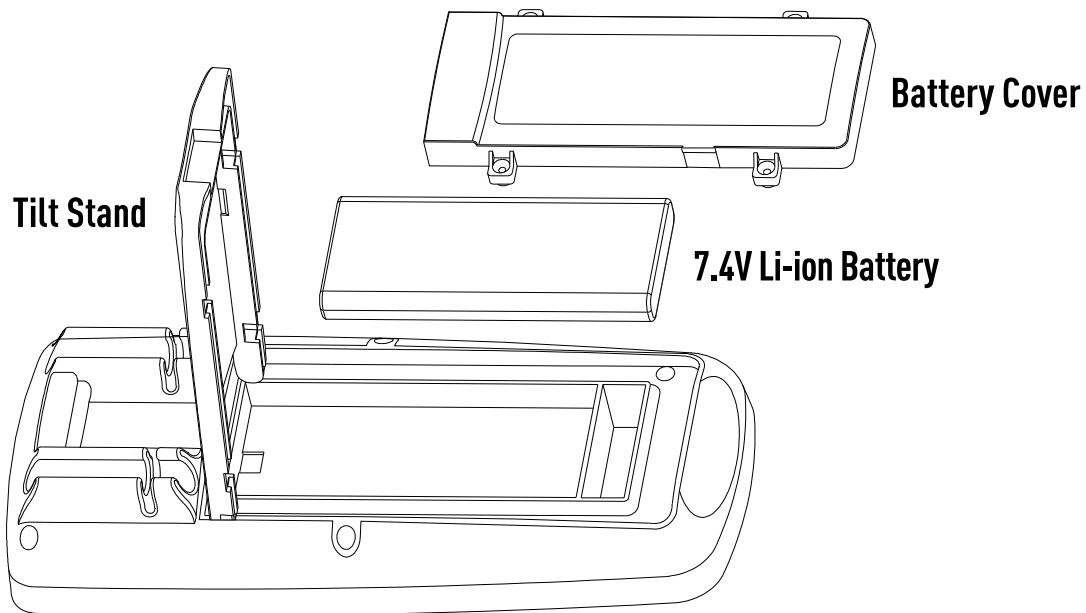

4-38.Replacing the Fuses

- 1.Turn the Meter off and remove the test leads from the terminals.
- 2.Remove the battery door assembly by using a standardblade screwdriver to turn the battery door screw one-half turn counterclockwise.
- 3.Remove the fuse by gently prying one end loose, then sliding the fuse out of its bracket.
- 4.Install only specified replacement fuses.
- 5.Reinstall the battery door assembly and secure it by turning the screw one-half turn clockwise.

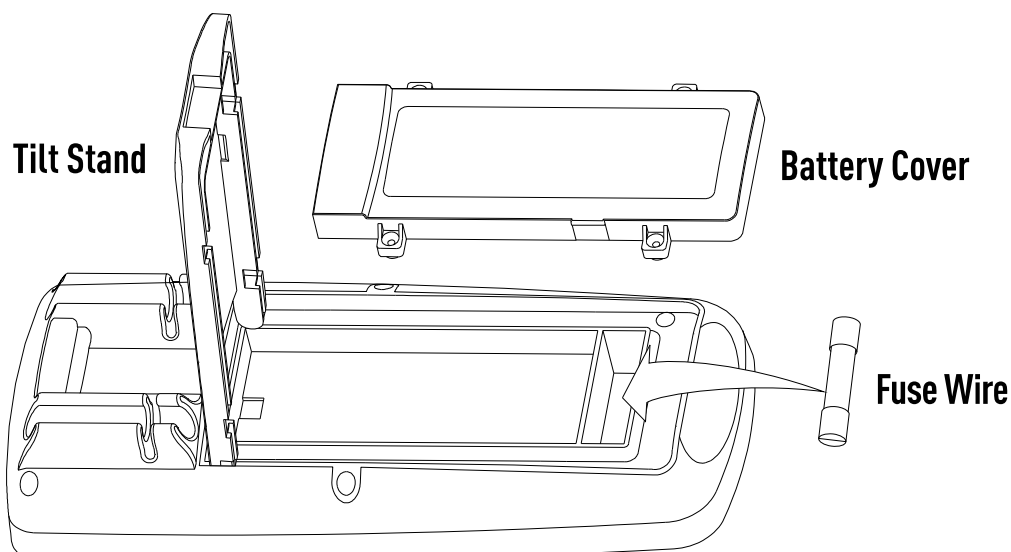

5.Specifications

5-1.Technical Specifications

Function	Range	Resolution	Accuracy
DC Voltage	50mV *	0.001mV	$\pm(0.05\% + 20 \text{ digits})$
	500mV *	0.01mV	
	5V	0.0001V	$\pm(0.025\% + 5 \text{ digits})$
	50V	0.001V	
	500V	0.01V	$\pm(0.05\% + 5 \text{ digits})$
	1000V	0.1V	$\pm(0.1\% + 5 \text{ digits})$

* When using the relative mode (REL Q) to compensate for offsets.

AC Voltage			50/60Hz	$\leq 1\text{kHz}$	$\leq 5\text{kHz}$	$\leq 100\text{kHz}^*$
	50mV	0.001mV	$\pm(0.3\% + 25 \text{ digits})$	$\pm(1.0\% + 25 \text{ digits})$	$\pm(3.0\% + 25 \text{ digits})$	$6.5\% + 2.0\text{mV}$
	500mV	0.01mV				
	5V	0.0001V				$6.5\% + 0.02\text{V}$
	50V	0.001V				$6.5\% + 0.3\text{V}$
	500V	0.01V		$\pm(1.5\% + 25 \text{ digits})$	$\pm(3.5\% + 25 \text{ digits})$	Unspecified
	1000V	0.1V			Unspecified	Unspecified

AC voltage ranges are specified from 5% of range to 100% of range.

* Upper 10 % of range and upper 30mv,sine wave

AC+DC Voltage	50.000mV	0.001mV	$<1\text{kHz}: \pm(1\% + 25 \text{ digits})$ $<5\text{kHz}: \pm(3.5\% + 25 \text{ digits})$
	500.00mV	0.01mV	
	5.0000V	0.0001V	
	50.000V	0.001V	
	500.00V	0.01V	$<1\text{kHz}: \pm(1.5\% + 25 \text{ digits})$
	1000.0V	0.1V	

DC Current	500 μA	0.01 μA	$\pm(0.1\% + 20 \text{ digits})$
	5000 μA	0.1 μA	
	50mA	0.001mA	
	500mA	0.01mA	$\pm(0.15\% + 20 \text{ digits})$
	10A	0.001A	$\pm(0.3\% + 20 \text{ digits})$

20A: 30 sec max with reduced accuracy.

Function	Range	Resolution	Accuracy
AC Current (50 to 10kHz)	500 μ A	0.01 μ A	50/60Hz: $\pm(0.6\% + 25 \text{ digits})$ <1kHz: $\pm(1.5\% + 25 \text{ digits})$ <10kHz: $\pm(3\% + 25 \text{ digits})$
	5000 μ A	0.1 μ A	
	50mA	0.001mA	
	500mA	0.01mA	
	10A	0.001A	

20A: 30 sec max with reduced accuracy.

All AC current ranges are specified from 5% of range to 100% of range.

AC+DC Current (0 to 1kHz)	500 μ A	0.01 μ A	$\pm(1.0\% + 25 \text{ digits})$
	5000 μ A	0.1 μ A	
	50mA	0.001mA	
	500mA	0.01mA	
	10A	0.001A	$\pm(1.5\% + 40 \text{ digits})$

Resistance	50 Ω *	0.001 Ω	$\pm(0.5\% + 20 \text{ digits})$
	500 Ω *	0.01 Ω	$\pm(0.05\% + 10 \text{ digits})$
	5k Ω	0.0001k Ω	
	50k Ω	0.001k Ω	
	500k Ω	0.01k Ω	$\pm(0.1\% + 10 \text{ digits})$
	5M Ω	0.0001M Ω	$\pm(0.2\% + 20 \text{ digits})$
	50M Ω	0.001M Ω	$\pm(2\% + 20 \text{ digits})$

* When using the relative mode (REL Q) to compensate for offsets.

Capacitance	5nF *	0.001nF	$\pm(2\% + 40 \text{ digits})$
	50nF *	0.01nF	
	500nF	0.1nF	
	5 μ F	0.001 μ F	
	50 μ F	0.01 μ F	
	500 μ F	0.1 μ F	$\pm(5\% + 40 \text{ digits})$
	10mF	0.01mF	

* With a film capacitor or better, using relative mode (REL Δ) to zero residual.

Function	Range	Resolution	Accuracy
Frequency (Electronic)	50Hz	0.001Hz	$\pm(0.01\% + 10 \text{ digits})$
	500Hz	0.01Hz	
	5kHz	0.0001kHz	
	50kHz	0.001kHz	
	500kHz	0.01kHz	
	5MHz	0.0001MHz	
	10MHz	0.001MHz	

Sensitivity: 2V RMS min at 20% to 80% duty cycle and <100kHz; 5V RMS min at 20% to 80% duty cycle and >100kHz.

Frequency (Electrical)	40.00-10kHz	0.01-0.001kHz	$\pm(0.5\% \text{ reading})$
---------------------------	-------------	---------------	------------------------------

Sensitivity: 2V RMS


Duty Cycle	0.1 to 99.90%	0.01%	$\pm(1.2\% + 2 \text{ digits})$
------------	---------------	-------	---------------------------------

Pulse width: 100 μ s-100ms; Frequency: 5Hz to 150kHz

Temp (Type-K)	-50 to 1000°C	0.1°C	$\pm(1.0\% + 2.5^\circ\text{C})$
	-58 to 1832°F	0.1°F	$\pm(1.0\% + 4.5^\circ\text{F})$

Probe accuracy not included

5-2.General Specification

Enclosure	Double Molded, Waterproof
Shock (Drop Test)	2 meters (6.5 feet)
Diode Test	Test current of 0.9mA maximum; Open circuit voltage 3.2V DC typical
Continuity Check	Audible signal will sound if the resistance is less than 25 Ω (approx.), test current <0.35mA
PEAK	Captures peaks >1ms
Temperature Sensor	Requires type K thermocouple
Input Impedance	>10M Ω VDC & >9M Ω VAC
AC Response	True RMS
AC True RMS	The term stands for "Root-Mean-Square" which represents the method of calculation of the voltage or current value. Average responding multimeters are calibrated to read correctly only on sine waves and they will read inaccurately on non-sine wave or distorted signals. True rms meters read accurately on either type of signal.
ACV Bandwidth	50Hz to 100000Hz
Crest Factor	≤ 3 at full scale up to 500V, decreasing linearly to ≤ 1.5 at 1000V.
Display	50,000 count backlit liquid crystal with bargraph
Overrange indication	"OL" is displayed
Auto Power Off	5-30minutes (approximately) with disable feature.
Polarity	Automatic (no indication for positive); Minus (-) sign for negative.
Measurement Rate	20 times per second
Low Battery Indication	"  " is displayed if battery voltage drops below operating voltage.
Fuses	Fuses are FF 0.8A/1000V, FF 10A/1000V
Operating Temperature	5 to 40°C (41 to 104°F)
Storage Temperature	-20 to 60°C (-4 to 140°F)
Operating Humidity	Max 80% up to 31°C (87°F) decreasing linearly to 50% at 40°C (104°F)
Storage Humidity	<80%
Operating Altitude	2000meters (7000ft.) maximum.
Safety	This meter is intended for origin of installation use and protected, against the users, by double insulation per EN61010-1:2010 and EN61010-2-030:2010, EN61010-2-033:2012 to Category IV 600V and Category III 1000V; Pollution Degree 2. The meter also meets UL 61010-1, 3rd Edition, CAN/CSA C22.2 No. 61010-1, 3rd Edition and IEC 61010-2-033(First Edition).
Bluetooth Specification	Version 4.0+EDR, Frequency range 2400MHz...2483.5MHz (ISM-Band), Guard band 2MHz <F <3.5MHz. Modulation method GFSK, 1 Mbps, 0.5 Gaussian; Receiving signal range -82 to -20dBm; Transmission power Minimum: -18dBm to 4dBm.
Built-in lithium	Diameter: 20.0mm; High 3.2mm; Typical Weight 3.0 grams (0.10 oz.); Designation: ANSI/NEDA-5004LC, IEC-CR2032; Normal Voltage: 3.0Volts; Typical Capacity: 240mAh; Storage 5 Year.
Li-ion Battery	Chemical type: Lithium polymer, Standard: GB/T Chemical type: Lithium polymer, Standard: GB/T up Voltage: 8.4 Volts; Typical Capacity: 2400 mAh. Cycle life: 500 times.

Part 2

Operating Instruction for Oscilloscope Section



6. Summary

The manual introduces operation information of Digital Oscilloscope which includes the following chapters:

- **“Introduction”** Presents the front panel, user interface, function check and probe of the oscilloscope.
- **“Function Introduction and Operation”** Makes a detailed introduction of oscilloscope function and operation.
- **“Application Example”** Includes many examples of testing, for readers’ reference.
- **“Daily Maintenance”** Daily maintenance and cleaning” briefly presents how to maintain the oscilloscope.
- **“Specifications”** Specifications details the specifications of Digital Oscilloscope.

7. Features

- Brand new design, compact size, simple portability
- TFT color LCD display, waveform display much more clear and stable
- Real time sample rate: 500Sps—50 Msa/s
- Storage depth: 3Kpts
- Trigger function: rising edge, falling edge
- Waveform record
- Auto search
- 10 set waveform storage/output; waveform data can be transmitted by Bluetooth or wireless USB interface to upper computer for further operation
- Cursor test
- Multi-screen display for channel waveform and FFT waveform
- Menu display mode, much flexible and natural operation for customer
- English online help system

8. General Safety Requirements


- Know about the following safety precautions to avoid personal injury, also to prevent damage generated by connection of this product with any other product.
- In order to avoid any potential danger, please use the product according to the regulation.
- Only qualified technical personnel can take the maintenance procedures.
- Prevent fire disaster or personal injury.
- Use proper charger, only special charger for this product confirmed by user's country is available.
- Insert and pull out correctly, don't insert or pull out while test wire is connecting with power cable.
- Connect the probe correctly, probe ground wire is the same as earth potential, please don't connect the ground wire to a high voltage.
- During the test procedure, please don't touch bare contacts or components.
- Check all the terminal ratings, in order to prevent danger of fire and electrical shock, please check all the ratings and notes of this product.
- Before connecting the device, please read the user manual for further information of concerned ratings.
- Don't operate with the cover opened, if the cover-plate or face-plate is removed, please don't use the device.
- Use proper fuse wire, only the fuse wires which compliances with specified type and ratings of this product can be adopted.
- Don't operate while suspecting product malfunction, if suspect any damage of this device, please inform qualified maintenance personnel to examine.
- Avoid circuit exposure, don't touch any bare contact or component after connection of industrial frequency power.
- Please don't operate under an inflammable or explosive circumstance.
- Keep device surface clean and dry.

9.Introduction

- The Digital Oscilloscope, is of compact size, powerful and easily operated, TFT color LCD display, realizing its ease of use which can greatly improve customer's work efficiency.
- The Digital Oscilloscope performs outstandingly, powerful, affordable, with a high cost performance.
- Its real time sample rate is up to 50 MSa/s, can meet the market needs of high capture speed, complicated signal.
- Supports internal storage and Bluetooth data transmission, customer can take repeated measurements and prints of the data graph by upper computer.
- The Digital Oscilloscope is a small and handy portable device, which can measure by taking suspension ground voltage as reference.
- Waterproof function, can be used in mobile state.

9-1.General Knowledge of Front Panel


- Before operating Digital Oscilloscope, need to know the front operational panel of the oscilloscope, the following content makes a brief description and introduction of operation procedures and functions of the meter front panel, enable the user to be familiar with the meter in minimal time.
- Digital Oscilloscope provides a simple but with clear function front panel, to make sure the convenience of basic operation to user.
- The front panel includes 4 function keys (F1-F4), 4 direction keys, 4 selection keys (HOLD, MODE, AUTO, REC), user can enter into different functional menus or directly obtain specific function applications by using these keys.

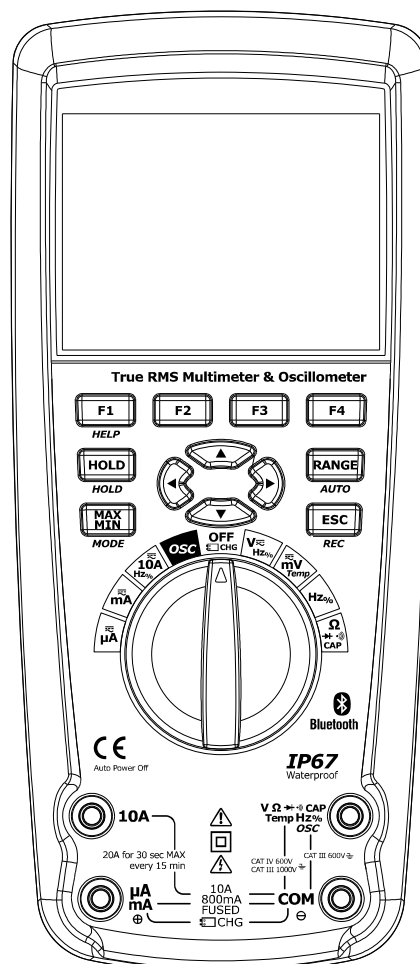

Operation Panel

9-2. User Interface of Digital Oscilloscope


- | | |
|------------------------------------------------|-------------------------------|
| 1-Date and Time | 7-Waveform Measured Frequency |
| 2-Status of Current Waveform Windows | 8-Preset Sample Rate |
| 3-Remaining Power of Battery | 9-Trigger Mode Mark |
| 4-Waveform Display Area | 10-Fast Display Mark |
| 5-Waveform Peak Value | 11-Slow Display Mark |
| 6-Signal Coupling Marks, Preset Amplitude Gear | 12-Operation Prompt Bar |

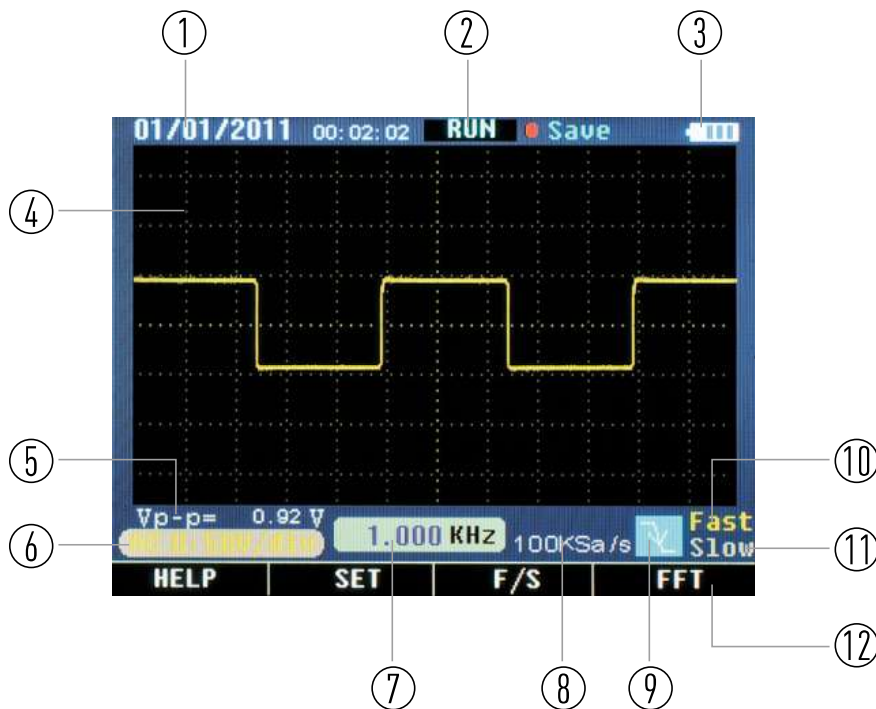

9-3. Brief Function Examination

Perform a fast function examination to test and verify if the oscilloscope works well or not, please proceed as follows:

1. Turn the knob, turn on the oscilloscope power.
2. Connect the oscilloscope to signal source, various AC signal can be adopted, including 110V/220V AC power.
3. Press "AUTO", corresponding frequency and peak waveform can be detected in several seconds.
4. If connect to 110V/220V AC power, press ▼ directly indicating 100V/div, press ◀ or ▶ indicating 1KSa/s, alternating sine wave can be observed.

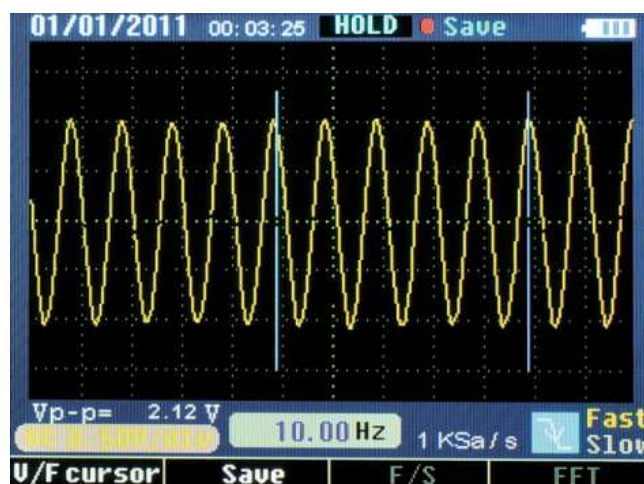

9-4.Probe and Connector



9-4-1.Safety of Probe and Connector

- The protective device of probe and connector main part prevents fingers from electric shock.
- Before any measurement, connect the probe and the connector with the oscilloscope.

Note:

- To avoid electric shock while using the probe, keep the fingers on the back of protective device of the probe main part.
- To avoid electric shock, don't touch the metallic part of the probe top while connecting to voltage source.
- Measured signal by the oscilloscope is taken as a reference voltage to the ground, make sure the ground terminal connect to the earth correctly, do not cause a short circuit.

9-4-2.Probe Application


- 1.Connect the oscilloscope probe with the connector, and insert into the input terminal of the device.
- 2.If use probe hooked head, make sure the hook end firmly stuck in the probe.
- 3.Probe connection mode must be adopted while the measuring frequency of the signal is above 1kHz.

10.Function and Operation

In order to operate the oscilloscope efficiently, user needs to know the following functions:

- Interface and Buttons
- Connector and Probe
- Settings of System
- Vertical System
- Horizontal System
- Trigger System
- Signal Capture System
- Display System
- Measuring System
- Memory System
- Auxiliary System
- Online Help System

10-1.Interface and Buttons

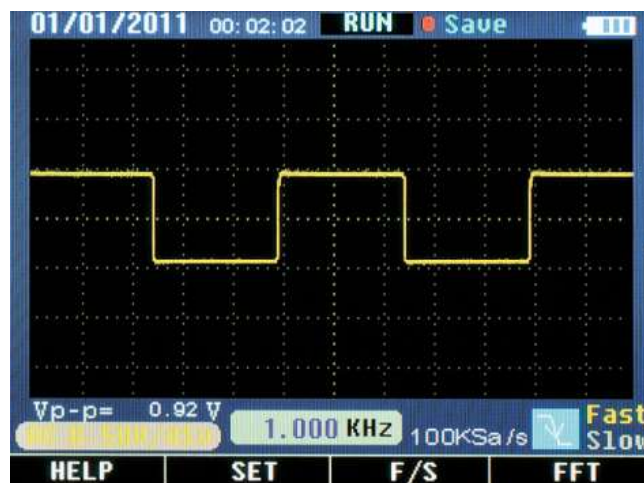



- Please follow the prompts of display interface for the use of F1-F4.
- HOLD key (freezes all the readings in the display).
- MODE function key switch (switch the cursor and waveform position).
- AUTO auto search key (search waveform of unknown frequency or amplitude).
- REC record key (record current waveform content, the length is 10 pages).
- ▲▼◀▶ direction key (adjust sample rate, preselecting amplitude and etc.).

10-2.Connector

- Connector is adopted for the connection of probe and oscilloscope, the probe and connector must be used when the measuring frequency of waveform is above 1KHz.
- When measured signal is a waveform of DC or its measuring frequency is below 1kHz, the stick of general oscilloscope can be adopted.
- If the device is suspended, don't need to differentiate phase line or null line when measuring industrial frequency voltage.

10-3.Help Section

- For the convenience of user, built-in simple instructions in Digital Oscilloscope is available, part one presents the function of various function keys, part two indicates quick start use.
- Press F1 (HELP) enter into help section, press F4 quit from help section.

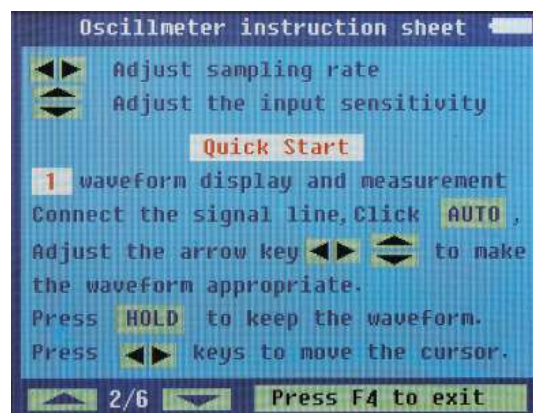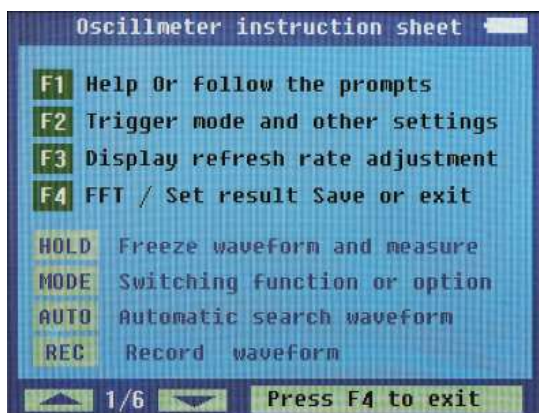


10-4.System Settings

- The Digital Oscilloscope can adjust relative trigger mode according to input signal.
- Setup the coupling mode according to input signal.
- Setup the warning tone is activated or not.

Function	Observations
Trigger Mode	Rising edge, falling edge, no trigger
Coupling Mode	AC coupling, DC coupling
Warning Tone	Key tone, no key tone

- Set up by taking the following steps:
 1. Running state (RUN), press F2 according to the prompt (SET), enter into setup interface (System Setup).
 2. Press ▲▼ by user's needs to select the function in chart.
 3. Press ◀▶ by user's needs to select the observation in chart.
 4. Press F4, save the settings and quit, see picture.

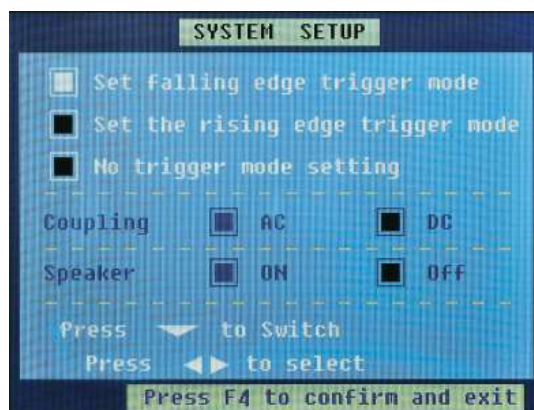

10-5.Fast/Slow Display

- When the measured signal is unstable, displayed waveform presents jumping, long-term observation may cause eye fatigue.
- Digital Oscilloscope offers the selection of fast/slow display function, press F3 (F/S), fast display can be switched to slow display, which can efficiently improve eye fatigue, "Slow" turns to yellow at status bar of interface, means activated.
- If press again, switch back to fast display, "Fast" turns to yellow, means fast display activated.
- Default fast display after start up.

10-6.Vertical System

- Press ▲ ▼ to adjust vertical system, default attenuation ratio, that is, preselected frequency (xxV/div) of adjusting input end after start up presents the status of last shutdown.
- While selecting DC coupling, as direct current exist in waveform, it may turn to one side, press "MODE", switch function of ▲ ▼ to adjust waveform up and down position, make the waveform back to middle position by pressing ◀ ▶, for convenient observation and measurement.

10-7.Horizontal System



- Press ◀ ▶ to adjust horizontal system, default adjust of sample rate after startup, that is, xxKSa/S.
- Press "MODE" then ◀ ▶ if user wants to change the trigger horizontal position in memory (trigger displacement).

10-8.Trigger System

- Trigger function confirms the time of collecting data and displaying waveform for the oscilloscope.
- After correctly set up the trigger, the oscilloscope can switch unstable displayed result to meaningful waveform.

10-9.Trigger Mode

- 2 kinds of trigger mode for the oscilloscope: raising edge and falling edge.
- When signal voltage across trigger electrical level, raising and falling edge of input signal is adopted for triggering.
- Raising edge setup: Press **Setup** → **Trigger** → **Raising Edge** → **Save and Quit**.
- Falling edge setup: Press **Setup** → **Trigger** → **Falling Edge** → **Save and Quit**.
- If select **Setup** → **Trigger** → **No trigger** → **Save and Quit**, the oscilloscope may lose synchronizing signal and any signal measured by fast display.

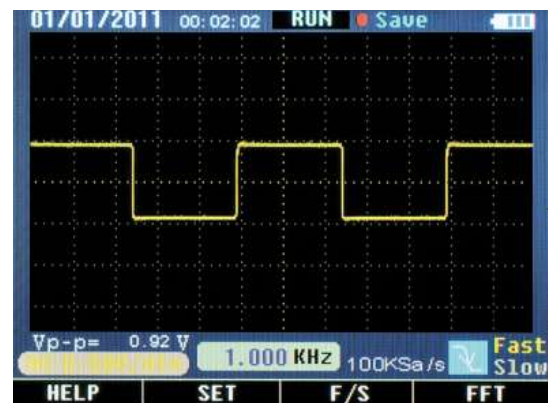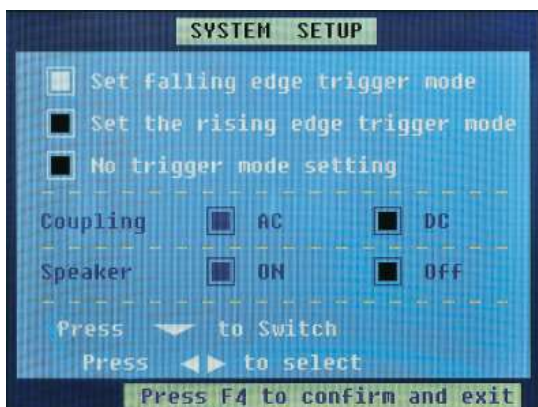

10-10.Channel

- Oscilloscope vertical response should be slightly greater than its bandwidth, so that FFT frequency spectrum can be higher than effective frequency of oscilloscope bandwidth, however, amplitude close to or higher than the bandwidth will not be accurate.
- If channel coupling mode is DC, user can measure DC component of signal by observing the difference between waveform and signal ground.
- If coupling mode is AC, DC component is filtered in the signal, this mode makes user easily display the AC component of signal with higher sensitivity.

Channel Settings


- Channel coupling settings, measured signal is sinusoidal signal containing DC bias:
- Press **Setup**→**Coupling**→**AC**, select AC coupling mode, DC component in measured signal is separated.
- Press **Setup**→**Coupling**→**DC**, select DC coupling mode, DC and AC component in measured signal can all pass.

10-11.FFT Frequency Spectrum Analysis

- Time signal can be converted into frequency component (frequency spectrum) by using FFT mathematical operation (Fast Fourier Transform).
- Observe following signals by FFT mathematical mode:
 - 1.Analyze harmonic wave in power line
 - 2.Measure harmonic wave content and distortion in system
 - 3.Measure impulse response of filter and system
 - 4.Analyze oscillation


10-11-1.Set Up Time Domain Waveform

- Press "AUTO" to display proper waveform.
- If displayed waveform shows unsatisfactory, press "◀▶" and "▲▼" for adjustment.
- Press F4 (FFT), the oscilloscope may adopt the 256 central points of time domain waveform to calculate FFT frequency spectrum.
- According to Nyquist criterion, press "◀▶", make sampling rate up to at least 2 times of input signal frequency.

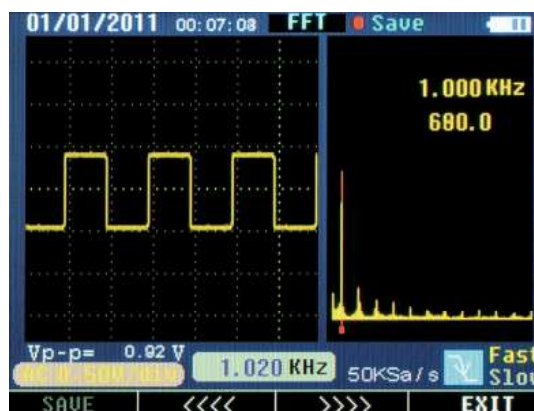

10-11-2.FFT Frequency Spectrum Display

- Press “F4” FFT button, display FFT frequency spectrum, in which a channel waveform and FFT waveform are shown in the split screen, FFT windows instructions.
- As the oscilloscope takes FFT transform for time records of limited length, FFT calculation mode bases on repeated YT waveform.
- In this case, if the cycle is integer, frequency values of YT waveform are the same at the beginning and the end, the waveform may not be interrupted, however, if the YT waveform cycle is not integer, frequency values shows different at the beginning and the end, high-frequency transient interrupts occur at connecting part.
- That is so-called “leakage” in frequency domain, therefore, in order to avoid leakage, multiply a window function with the original waveform, forcing the values at the beginning and the end to 0.

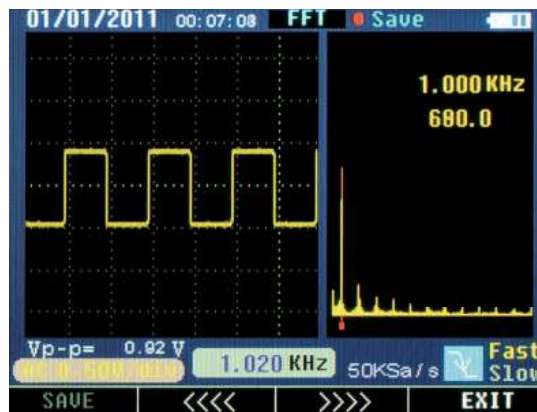

10-11-3.Position FFT Frequency Spectrum

- “◀▶” button can still be pressed under FFT interface to change sampling rate, to realize horizontal amplification or minification.
- Adjust “▲▼” to realize vertical amplification or minification.

10-11-4.Measure FFT Frequency Spectrum by Cursor


- Two kinds of measurement can be taken for FFT spectrum by using cursor: Amplitude (Relative Value) and Frequency (unit: Hz).
- Under FFT interface, press F2 (◀◀◀) or F3 (▶▶▶) according to prompt bar to move red cursor, corresponding frequency and relative amplitude can be measured.

Note:

- DC component or deviation existed in signal may cause error or deviation in FFT waveform component part. Select DC coupling mode to reduce AC component.
- Nyquist frequency: for waveform, of which highest value ups to F , sampling rate of $2F$ must be adopted to rebuild the waveform, that is also called Nyquist criteria, “ F ” means Nyquist frequency, “ $2F$ ” means Nyquist rate.

10-12.Signal Capture System


- Real-time sampling: the memory space should be full for every sampling, real-time sampling rate up to 50MSa/s.
- The system is under default continuous sampling state after startup, press “HOLD” if user wants to take static measurement, press the same button again to turn back to continuous sampling state.
- “REC” button: if the user needs the oscilloscope to take sample of enough data to analyze a series of numbers, press “REC”, the oscilloscope may continuously take data sample of 10 pages for measurement analysis.
- Time base: The oscilloscope takes sample of input signal values at discontinuous points to digitalize the waveform, frequency of value digitalization can be controlled by adopting time base, press “◀▶”, adjust the time base to a horizontal level to satisfy user’s needs,
- False wave phenomenon: If the speed of sampling is not fast enough, causing inaccurate waveform records, “false wave phenomenon” occur, in this case, the oscilloscope displays the waveform by a frequency which is below actual input waveform’s frequency, or triggers and displays unstable waveform, therefore, press “AUTO” to auto search for the first measurement of new signal, to confirm the basic frequency of this signal.

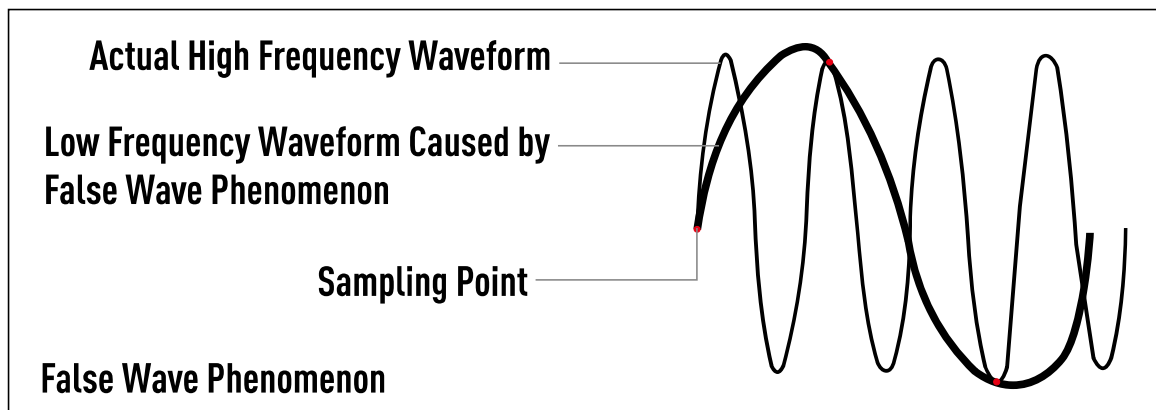

10-13.Display System


10-13-1.Time and Date

- After startup, actual time and date display at the top left corner on the interface, format: mm/dd/yy, hh/mm/ss.
- Function of the clock is supplied by the back-up battery inside of the device, which can work for 5 to 10 years and irrelevant to the Li-ion rechargeable battery.
- Take “Operating Instructions For Oscilloscope” for reference for the adjustment of clock.

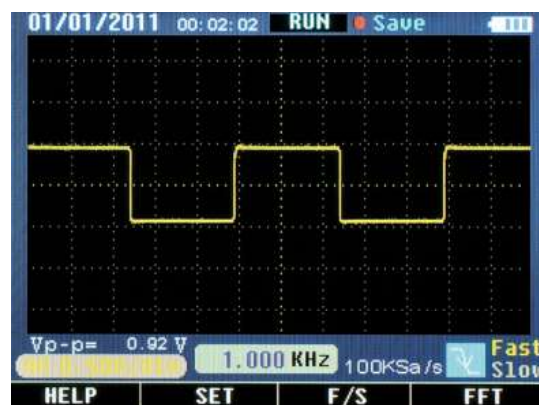

10-13-2. Battery Electric Power Display

- After startup, at the top right corner, display the working Li-ion rechargeable battery electric power.
- The battery fully charged, 4 cells.
- When 1 cell left, blue color turn to red, warning to recharge, 30 to 45 minutes may be used by this left power.
- All cells disappear, please recharge promptly, 15 to 20 minutes may be used by this left power.

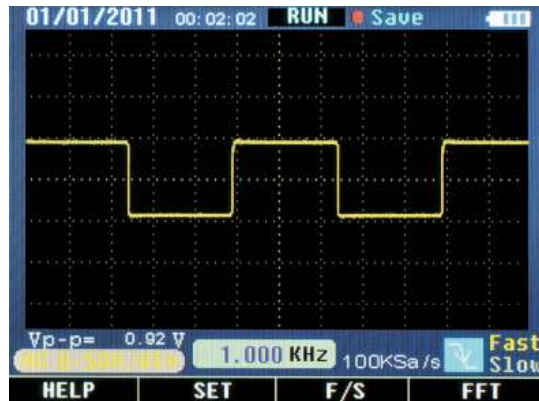

10-14. Measuring System

- The oscilloscope displays forms of voltage relative to time, and helps user measure and display waveforms.
- Two ways of measurements can be adopted: Scale measurement or cursor measurement.

10-14-1. Scale Measurement


- Fast and direct evaluation can be done by this way, for example, waveform amplitude can be observed to judge whether it's 0.8V or not.
- By calculating relevant primary and secondary scale division, then multiplying by proportion factor, simple measurement can be taken.
- For example, if four main vertical scale divisions between the waveform peak and base are figured out, proportion factor is 200 mV/division, peak value voltage can be calculated by the following method: 4 divisions \times 200mV/div = 0.8V.

10-14-2. Movement of Cursor

As the following picture shows, press "HOLD" or "REC", "V/Fcursor" appear in prompt bar, indicates function switch button for cursor measurement.


1. Blue vertical cursor appears on the displayed screen, press "◀▶" to move the cursor, one time for one space, press this key for more than 1 second for fast move, the cursor moves continuously in the same direction.
2. Press "MODE" to switch left/right cursor, lighter cursor indicates state of activation.
3. Display mode of frequency and cycle is also switched at the time of left/right cursor switch.
4. Activate left cursor displays frequency, right cursor for cycle.
5. Press F1 (V/F cursor), cursor measurement turns to voltage amplitude from frequency (cycle), up and down cursor appears on the screen at the moment.
6. If use needs to move the cursor, press "▲▼", one time for one space, press this key for more than 1 second for fast move, the cursor moves continuously in the same direction.

7. Press "MODE" to switch up/down cursor, lighter one indicates state of activation.

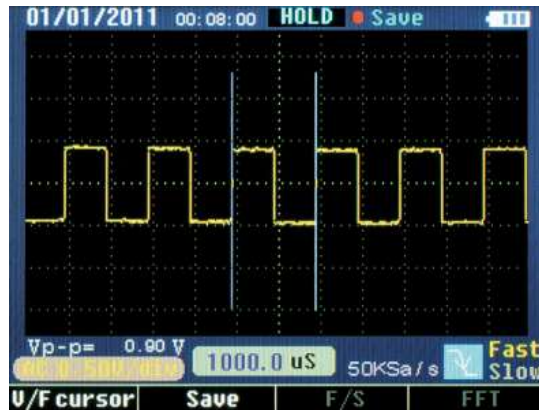


10-15. Cursor Data Measurement

- Manual cursor measurement- increment for horizontal or vertical coordinate figure and increment between two cursors.
- Time Cursor: Time cursor displays as vertical line on the screen, which can measure vertical parameter, result appears on the bottom of screen.

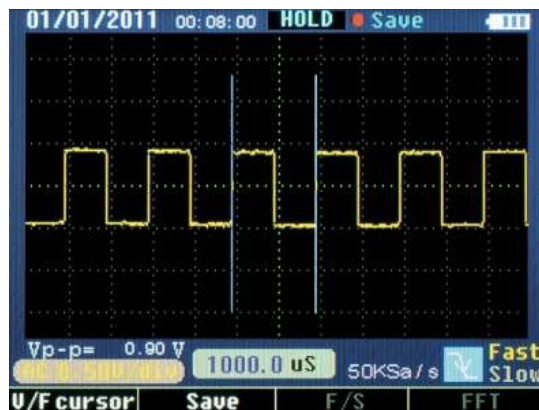

- Voltage Cursor: Voltage cursor displays as horizontal line on the screen, which can measure vertical parameter, result appears on the bottom.

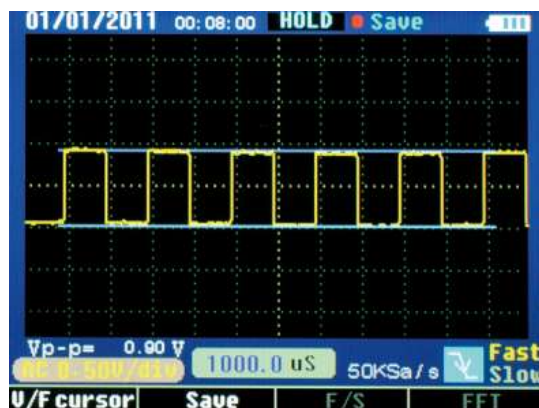

10-16.Waveform Records

- In order to clearly observe some serial signals, as UART, IIC, record mode can be used.
 - Press “REC”, the device captures and records signals, after the records, result displays on the screen by page order.
- 1.Press “NEXT”, turn to next page, 10 pages can be continuously turned.
 - 2.Press “PREVIOUS”, turn back to the previous page.
 - 3.State of movement and measurement of cursor is same as “HOLD”.

10-17.Memory System

- The Digital Oscilloscope memorizes 10 series waveforms to its internal memorizer, the memorized date can be stored for 10 years, memorizer space can be repeatedly used for one million times.
- The waveform data in it can be recalled back to current oscilloscope, or be sent to upper computer by its internal Bluetooth.
- As portable computer or PC, then be opened by relevant software in computer, measurement in computer may also be taken.

10-17-1.Store the current displayed waveform into the device.

- Press HOLD > F2 (Save) > Enter into “Save Operations” State > “▲▼” (Select position) > “F1 (Memory)”, when no store exists in the position (No store), store directly, the color may turn to purple red from green if storage succeeds.
- If previous store exists, system presents “Into the new?” if answer “yes”, original content is covered, current content is stored; if “no”, quit the operation.
- Press “F4 (EXIT)” to quit.

10-17-2.Store the record state waveform into the device.

- Press REC > F2 (Save) > “▲▼” (Select position) > F1 (Memory), rest steps same as 1.
- Press “F4 (back)” to turn back to flip operation interface of record state, press “REC” to quit.

10-17-3.Store FFT displayed waveform into device.


Press F4 (FFT) > HOLD > F1 (Save) > “▲▼” (Select position) > F1 (Memory), rest steps same as 1.

10-17-4.Deletion

- Under “Save Operations” state, press “▲▼◀▶” (Select position), then press “F2 (Delete)”, system presents “Are you sure?”.
- If answer “yes”, the content is deleted; if “no”, quit the operation.

10-17-5.Callout

- Under “Save Operations” state, press “▲▼◀▶” (Select position), then press “F3 (Recall)”, the selected content displays on the screen.
- The waveform data is sent to upper computer by Bluetooth or wireless USB while waveform callout.

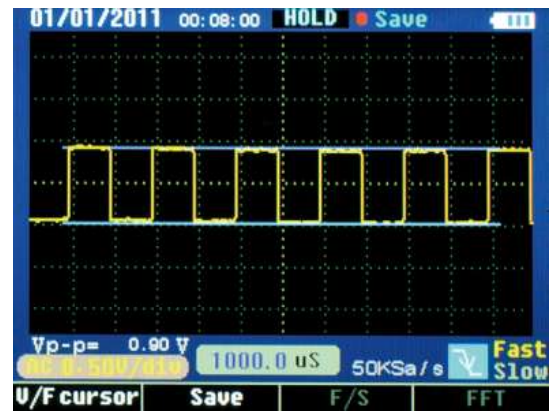

- Press F2 (return) under waveform displaying state, turn back to “Save Operations” state.
- Press “F4 (EXIT)” in waveform displaying state, turn back to waveform displaying state.

11.Examples

This chapter mainly introduces several application examples, these simplified examples focus on some main functions of the oscilloscope, and user may take it for reference to solve some actual testing problems.

- Simple measurement
- Cursor measurement
- Analyze detailed information of signal
- Analyze communication signal difference by mathematical computing function

11-1.Simple Measurement

- Observe unknown signal in circuit, fast display the frequency and peak value of the measured signal.
- Auto search function, in order to fast display the signal, take following steps:
 - 1.Connect correctly the probe and connector.
 - 2.Press "AUTO", wait a moment, the oscilloscope auto searches most of the displayed signals.
- User can take manual adjustment on this basis, until the displayed waveform satisfies user's needs.

Note: the oscilloscope displays corresponding auto search result in waveform area on the screen according to detected signal type.

11-2.Cursor Measurement

The oscilloscope can auto measure most displayed signals, if needs to accurately measure the frequency and peak value of signal, take following steps:

- Measure Signal Frequency
 - 1.Press "HOLD", freeze the waveform.
 - 2.Press ◀ or ▶, to move left cursor.
 - 3.Press "MODE", to switch cursor, press ◀ or ▶, to move right cursor.
 - 4.Read the time (cycle) between the two cursor press "MODE", read corresponding frequency.
- Measure Signal Peak Value
 - 1.Press "F1 (V/F cursor)" after step 1, switch to horizontal cursors, press ▲ or ▼ to move up cursor.
 - 2.Press "MODE", to switch cursor, press ▲ or ▼ to move down cursor.
 - 3.Read the voltage value between two cursors.

11-3.Serial Signal Measurement

To measure serial signals, as UART, IIC, SPI and etc, please take following steps:

- 1.Ake **11.1** operations as reference, preliminary observe the measured signal.
- 2.Press "REC" while signal transmission.
- 3.Press "NEXT" or "Previous" according to prompt bar on the screen to check corresponding page.
- 4.Take **11.2** operations as reference, press ◀ ▶ and "MODE" to move the cursor, signal frequency can be measured.

11-4. Analyze AC Signal by FFT

- Observe amplifying circuit in device, analyze output harmonic component and observe its distortion by FFT.
 - To adopt FFT function, following steps can be taken.
1. Connect the input end of the amplifying circuit to sine wave signal.
 2. Connect the oscilloscope probe to output end of amplifying circuit.
 3. Take 3.1 operations as reference, proper signal can be observed.
 4. Press "F4 (FFT)", observe frequency spectrum of output waveform for amplifying circuit after Fast Fourier Transform.
 5. Adjust the input signal source of amplifying circuit, observe FFT.
 6. Press "F2 (◀◀◀)" or "F3 (▶▶▶)" to adjust position of red cursor, read corresponding frequency and amplitude ratio of dominant wave and harmonic wave.

11-5. Waveform Save

Waveform data save should be operated under static state, three ways lead to "static" state, then operate according to screen prompts.

1. Press "HOLD" + "F2 (SAVE)".
2. Press "REC" + "F2 (SAVE)".
3. Press "FFT" + "HOLD" + "F1 (SAVE)".

12. Fault Processing

12-1. General Fault Processing

- If turn the oscilloscope switch to any gear, still black screen, no any display, please operates by following steps:

1. The Li-ion battery may be used out, please recharge it.
2. Recharge the battery by matched charger for 5 to 10 minutes, try again.
3. If still no display, Li-ion battery may be damaged, need to change.

- Press "AUTO", if waveform of signal doesn't display on the screen, please take following steps:

1. Verify if the probe is correctly connected to signal cable.
2. Verify if the signal cable is correctly connected to connector.
3. Verify if the probe is correctly connected to measured object.
4. Verify if the measured object emits signals.
5. Press "AUTO" to try again.

12-2. Waveform Displays, But Cannot Stabilize

1. Check the trigger option is correct or not, waveform stabilizes only proper trigger mode is operated.
2. Try to change "trigger mode" to falling edge or raising edge, waveform can not stabilize in "no trigger" state.
3. Try to change "▲" button, weak signal is vulnerable to be interfered, and emits unstable waveform.

12-3. Waveform Appears Ladder Shape

- Normal phenomenon, Level time-base gear may not be proper.
- Adjust horizontal time-base to raise the level resolution, display improved.

13.Daily Maintenance

- While store or place the device, please don't make LCD display surface exposed to direct sunlight for long time.
- To avoid device or probe damage, please don't place it in fog condition, liquid or dissolvent.
- Verify the device and probe frequently according to operation times.
- Wipe dust of external part of the device and probe with soft cloth.
- While cleaning the LCD screen, pay attention not to scratch the transparent plastic protection screen.
- Clean the device with a water soaked cloth, note to disconnect the power, if a more thorough clean is needed, 75% isopropanol water dissolvent can be used.

Note: To avoid device or probe damage, any abradant reagent or chemical cleaning reagent can not be adopted.

Note: Before cleaning the device, please make sure to disconnect all lines.

14.Specifications

Function	Main Specification	Format or Note
LCD Display	3.5" color TFT-LCD; 320 x 240 pixels	
Refresh Rate	15~50 V/S	Fast/Slow
Bandwidth	10MHz	0-10MHZ
Input	Coupling, AC, DC	AC, DC
Input Impedance	1000C/CA: $1\text{M}\Omega \pm 2\%$ / $15\text{pF} \pm 2\text{pF}$	
MAX Input Voltage	1000V/600V (DC+AC peak value, $1\text{M}\Omega$ input impedance)	CAT I, CAT II , CAT III
Probe Attenuation	1X	
Sampling Mode	Real time sampling, random sampling	Single channel 3K,
Real Time Sample Rate	50MSa/s~ 500pts	
Sampling Resolution	8 bits	
Record Length	3K/10pages	SRAM
Storage Length	10 charts	EEPROM
Time Error	$\pm 5\text{s}/24\text{hours}$	
FFT Collect	4-256 points	
Bluetooth Transmission Range	9600 baud rate	
Li-ion Battery	7.4V 2400mAH	

Part 3

Operating Instruction for Meterbox



- Meterbox iMM is the professional APP for iOS and Android which is for realtime & historical Voltage, Current, Resistance and Capacitance electric parameters measurement, for enhancement digital multimeter user experience about visualization, datalog & sharing, and data management and it needs to combine with Digital Multimeter for proceeding to the measurement.
 - With Meterbox iMM, user can complete the electrical measuring, enhance measuring visualization, data log & sharing, management, it promotes the efficiency and quality of electric measurement.
1. Wirelessly remote measure voltage, current, resistance and capacitance electric parameters.
 2. The measured data from Digital Multimeter can transfer to APP via bluetooth and visualize, store and log.
 3. The measuring data can be shared with others.



Download APP

