

876543

1

REVISIONS

ZONE	REV	DESCRIPTION	DATE	APPROVED
C3-2	E	REV DESCRIPTIONS A THRU D DELETED. DIRECT UPDATE: ER 732631 ADDED MOD DOT 5. REASON: 02, SEVERITY: 08	10/3/03	KSHAYATSU J SPENCE L KING D CHACE G CHILDS
C3-2	F	DIRECT UPDATE: ER 732948 ADDED MOD DOT 6. REASON: 02, SEVERITY: 08	10/10/03	KSHAYATSU J SPENCE L KING D CHACE G CHILDS
C8-1 D8-2	G	DIRECT UPDATE: ER 733380 ADDED FLAGNOTE 6. REVISED/ADDED INFO TO TABLE, SH2-3. REASON: 02, SEVERITY: 08	10/24/03	KSHAYATSU J SPENCE L KING D CHACE W LAMBERT

NOTES: UNLESS OTHERWISE SPECIFIED,

1

QUARTER-TURN FASTENERS: SLIDE SHEET METAL COVER (FIND NO 3) OVER CONFIGURATION ASSEMBLY (FIND NO 2) AND FULLY ENGAGE FASTENERS. ROTATE FASTENER ONE-QUARTER TURN CLOCKWISE AND ENSURE SPRING ENGAGEMENT.

2

LOCATE LABEL APPROXIMATELY AS SHOWN.

3

CENTER LABEL IN RECESS.

4

APPROPRIATE DASH NUMBER AND SERIAL NUMBER SHALL BE ON DATA MATRIX IDENTIFICATION PLATE PRIOR TO SHIPMENT.

5

MARK APPLICABLE MOD DOTS USING FIND NO. 11.

6

THE DRAWING AND BOM REVISION LEVELS SHOWN REPRESENT THE "RE-LEASED AT" LEVEL. ALL FUTURE REVISIONS AND DASHES OF THE SAME BASE NUMBERED DOCUMENT WILL INCORPORATE PREVIOUS MODS.

3

2

1

2

3

8


3

7

3

4

5

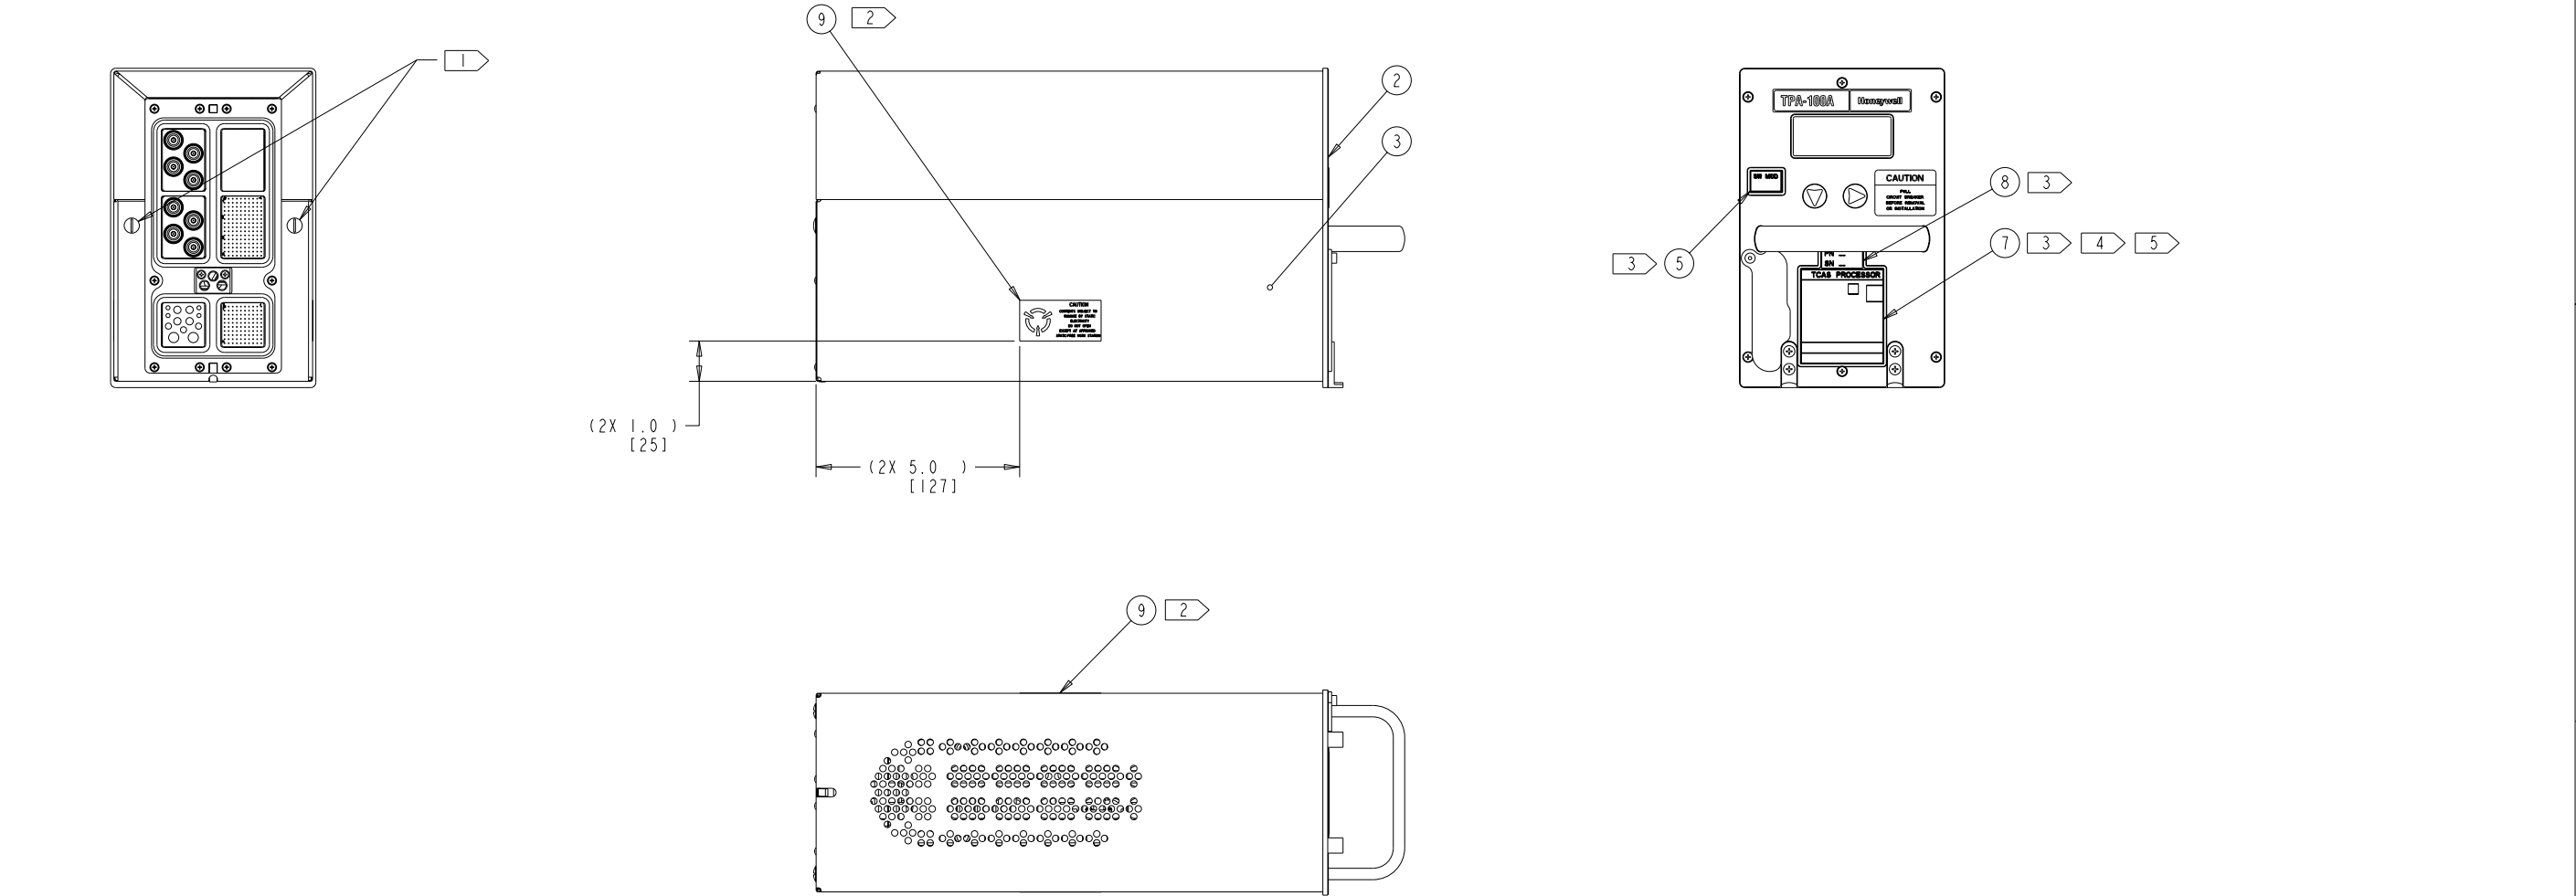

87654321

TPA-100A

SEE SEPARATE PARTS LIST

THIS DOCUMENT IS AN UNPUBLISHED WORK. COPYRIGHT 2002, 2003 HONEYWELL INTERNATIONAL INC. ALL RIGHTS RESERVED.

UNLESS OTHERWISE SPECIFIED

CONTRACT NO.

HONEYWELL INTERNATIONAL INC. REDMOND, WASHINGTON 98073-9701

Honeywell

HONEYWELL PROPRIETARY

THIS DOCUMENT AND ALL INFORMATION AND EX-PRESSION CONTAINED HEREIN ARE THE PROPERTY OF HONEYWELL INTERNATIONAL INC., ARE LOANED IN CONFIDENCE, AND MAY NOT, IN WHOLE, OR IN PART, BE USED, DUPLICATED OR DISCLOSED FOR ANY PURPOSE WITHOUT PRIOR WRITTEN PERMISSION OF HONEYWELL INTERNATIONAL INC.

INTERPRET DRAWING PER ASME Y14.100-2000

ANGLE PROJECTION

PRECIOUS METAL INDICATOR CODE NA

TYPED SIGNATURES CONSTITUTE APPROVAL. ACTUAL SIGNATURES ARE ON FILE AT HONEYWELL IN REDMOND, WA.

DWN KSHAYATSU 10/27/02

CHECK J CHUNGBIN 10-3-02

ENGR L KING 10-7-02

MFG D CHACE 10-11-02

QA G CHILDS 10/8/02

APPD

TITLE

TOP ASSEMBLY, TPA-100A, 4MCU

SIZE

CAGE CODE

DRAWING NO.

REV

D 97896

940-0400-001

G

SCALE: 1/2

WT: —

SHEET: 1 OF 3

REVISION STATUS OF SHEETS

DASH	NEXT ASSY	USED ON
-001	-	940-0400

REVISION STATUS OF SHEETS

12

1

2

3

4

5

6

7

8

8		7		6		5		4		3		DRAWING NO. 940-0400-001		SHEET 2		1	
RED LABEL UNITS ONLY																	
MOD DOT 5		ECP NO.		ER NO.		REASON FOR CHANGE				PARTS CHANGE				ASSEMBLY DESCRIPTION		ASSEMBLY/BOM, REV 6	
1		14860		727100		Historical Data.				Add Find No. 161 (R575 and R576) P/N: 104-5058-134. Add Find No. 162 (R577) P/N: 104-5058-018.				CCA, TCAS DATA PROCESSOR (CPU)		PL722-4350-003, G	
				727814		Change A/D input Bias.				Replaced Find No. 162 (R577) from P/N: 104-5058-018 RES, 18.2K, 0805, 1%,.1W with P/N: 104-5058-135 RES, 14.0K, 0805, 1%,.1W.				CCA, TCAS DATA PROCESSOR (CPU)		PL722-4350-003, H	
				733038		Change A/D input Bias.				Replaced Find No. 162 (R577) from P/N: 104-5058-018 RES, 18.2K, 0805, 1%,.1W with P/N: 104-5058-135 RES, 14.0K, 0805, 1%,.1W.				CCA, TCAS DATA PROCESSOR (CPU)		PL722-4350-003, F	
2		14832		729115		Unit fails antenna E4 BITE test at low temperature (-40°C).				Add jumper wire only.				CCA, RECEIVER		722-4435-001, G	
3		14853		731642		1. To change Pulse transformer (T6, T9 & T10) and inductors (L8, L9 & L17) for structural weakness. 2. To change 429 line drivers due to low temperature instability. 3. Need to change Pushbutton switches due to high temperature susceptibility.				1A. Replace Find No. 95 (L8 and L9) from P/N: 320-0243-001 with P/N: 320-0243-012. 1B. Replace Find No. 99 (L17) from P/N: 320-0242-001 with P/N: 320-0242-002. 1C. Replace Find No. 188 (T9) from P/N: 310-0537-001 with P/N: 310-0537-002. 1D. Replace Find No. 185 (T9) from P/N: 310-0536-001 with P/N: 310-0536-002. 2A. Replace Find No. 27 (U44 - U48, U56 - U60) from P/N: 321-2633-001 with P/N: 321-2633-004. 3A. Replace Find No. 9 (SW 1 AND 2) from P/N: 031-22207-0004 with P/N: 031-22207-0007.				1. CCA, POWER SUPPLY 2. CCA, TCAS DATA PROCESSOR (CPU) 3. CCA, FRONT INTERCONNECT		PL722-4348-004, C PL722-4350-005, C PL722-4354-004, F	
		14853R1		732360		1. To change Pulse transformer (T6, T9 & T10) and inductors (L8, L9 & L17) for structural weakness. 2. To change 429 line drivers due to low temperature instability.				1A. Replace Find No. 94 (L8 and L9) from P/N: 320-0243-001 with P/N: 320-0243-012. 1B. Replace Find No. 98 (L17) from P/N: 320-0242-001 with P/N: 320-0242-002. 1C. Replace Find No. 187 (T9) from P/N: 310-0537-001 with P/N: 310-0537-002. 1D. Replace Find No. 184 (T9) from P/N: 310-0536-001 with P/N: 310-0536-002. 2A. Replace Find No. 27 (U44 U48, U56 U60) P/N: 321-2633-001 with P/N: 321-2633-004.				1. CCA, POWER SUPPLY 2. CCA, TCAS DATA PROCESSOR (CPU)		PL722-4348-003, K PL722-4350-003, J	
4		14840		732257		DE11026 (Six channel Discrete-to Digital interface) discrete switch transitions to ground at 3.2 volts.				Replace Find No. 31, 14 places (U65 - U69, U73 - U76, U277 - U229 & U233 - U234) P/N: 321-2622-001 Adds P/N: 321-2622-002.				CCA, TCAS DATA PROCESSOR (CPU)		PL722-4350-003, G	
		14840R1		732360		Per ARINC 735A, they should transition at 3.5 volts.								CCA, TCAS DATA PROCESSOR (CPU)		PL722-4350-003, J	
5		14843		731921		1. Corrects a problem with the undervoltage and overvoltage operating limits to meet DO-160D requirements. 2. Corrects a problem during warm start conditions between 200 - 300 ms that prevented the unit from meeting the DO-160D 200 ms. Power transparency requirements.				Replaces CCA, POWER SUPPLY P/N: 722-4348-003 with P/N: 722-4348-004.				CCA, POWER SUPPLY		PL722-4348-004, D & 722-4348-004, * ONLY	
PROPRIETARY NOTICE ON TITLE PAGE APPLIES																	
SIZE D		CAGE CODE 97896		DRAWING NO. 940-0400-001				REV G									
SCALE: 1/2		WT: —		SHEET: 2													

