	Ant1	5310	-1.56	≤11.00	2.37	---	PASS
	Ant2	5310	-1.83	≤11.00	2.04	---	PASS
	total	5310	1.32	≤10.06	8.26	---	PASS
	Ant1	5510	-2.89	≤11.00	1.04	---	PASS
	Ant2	5510	-1.92	≤11.00	1.95	---	PASS
	total	5510	0.63	≤10.06	7.57	---	PASS
	Ant1	5550	-2.64	≤11.00	1.29	---	PASS
	Ant2	5550	-1.62	≤11.00	2.25	---	PASS
	total	5550	0.91	≤10.06	7.85	---	PASS
	Ant1	5670	-3.18	≤11.00	0.75	---	PASS
	Ant2	5670	-2.21	≤11.00	1.66	---	PASS
	total	5670	0.34	≤10.06	7.28	---	PASS
	Ant1	5710_UNII-2C	-2.83	≤11.00	1.10	---	PASS
	Ant2	5710_UNII-2C	-2.22	≤11.00	1.65	---	PASS
	total	5710_UNII-2C	0.50	≤10.06	7.44	---	PASS
	Ant1	5710_UNII-3	-8.22	≤30.00	-4.29	---	PASS
	Ant2	5710_UNII-3	-7.42	≤30.00	-3.55	---	PASS
	total	5710_UNII-3	-4.79	≤29.06	2.15	---	PASS
	Ant1	5755	-5.03	≤30.00	-1.10	---	PASS
	Ant2	5755	-4.53	≤30.00	-0.66	---	PASS
	total	5755	-1.76	≤29.06	5.18	---	PASS
	Ant1	5795	-4.43	≤30.00	-0.50	---	PASS
	Ant2	5795	-4.34	≤30.00	-0.47	---	PASS
	total	5795	-1.37	≤29.06	5.57	---	PASS
11AX80MIMO	Ant1	5210	-5.58	≤11.00	-1.65	≤10.00	PASS
	Ant2	5210	-5.18	≤11.00	-1.31	≤10.00	PASS
	total	5210	-2.37	≤10.06	4.57	≤10.00	PASS
	Ant1	5290	-5.02	≤11.00	-1.09	---	PASS
	Ant2	5290	-4.84	≤11.00	-0.97	---	PASS
	total	5290	-1.92	≤10.06	5.02	---	PASS
	Ant1	5530	-5.93	≤11.00	-2.00	---	PASS
	Ant2	5530	-5.19	≤11.00	-1.32	---	PASS
	total	5530	-2.53	≤10.06	4.41	---	PASS
	Ant1	5610	-6.20	≤11.00	-2.27	---	PASS
	Ant2	5610	-5.25	≤11.00	-1.38	---	PASS
	total	5610	-2.69	≤10.06	4.25	---	PASS
	Ant1	5690_UNII-2C	-5.80	≤11.00	-1.87	---	PASS
	Ant2	5690_UNII-2C	-5.21	≤11.00	-1.34	---	PASS
	total	5690_UNII-2C	-2.48	≤10.06	4.46	---	PASS
	Ant1	5690_UNII-3	-12.39	≤30.00	-8.46	---	PASS
	Ant2	5690_UNII-3	-11.85	≤30.00	-7.98	---	PASS
	total	5690_UNII-3	-9.10	≤29.06	-2.16	---	PASS
	Ant1	5775	-8.03	≤30.00	-4.10	---	PASS
	Ant2	5775	-7.75	≤30.00	-3.88	---	PASS
	total	5775	-4.88	≤29.06	2.06	---	PASS

Note：1.The Result and Limit Unit is dBm/500 kHz in the band 5.725−5.85 GHz.

2.The Duty Cycle Factor and RBW Factor is compensated in the graph.

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11.5.2. Test Graphs

11A_Ant1_5180

11A_Ant2_5180

11A_Ant1_5200

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
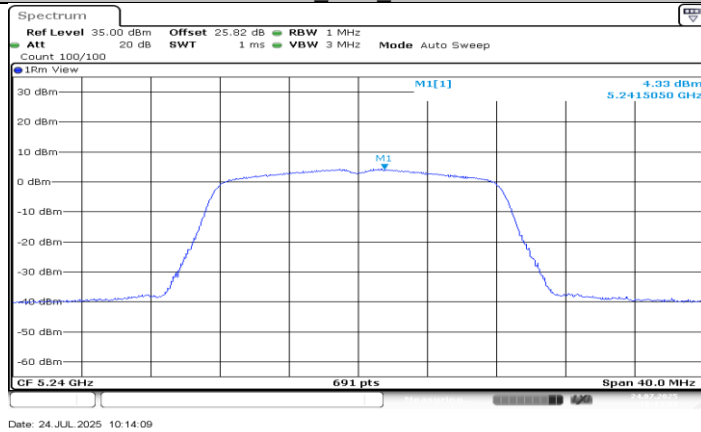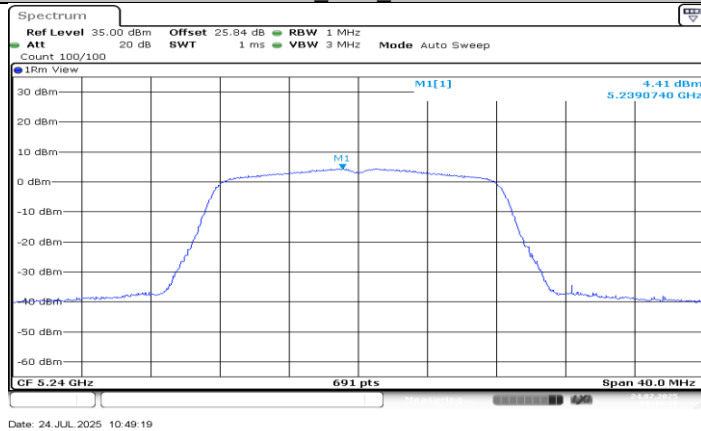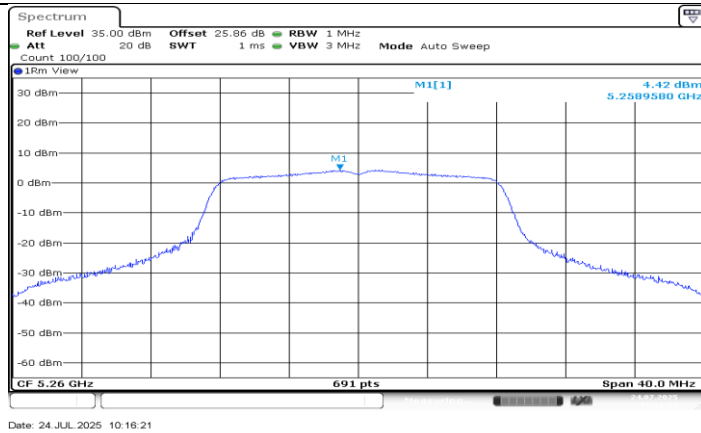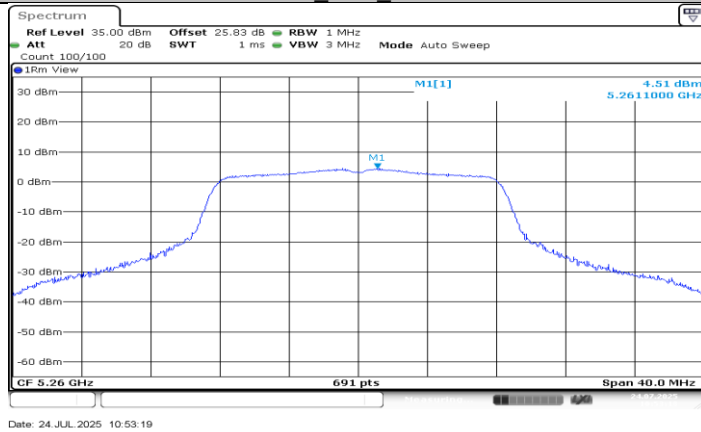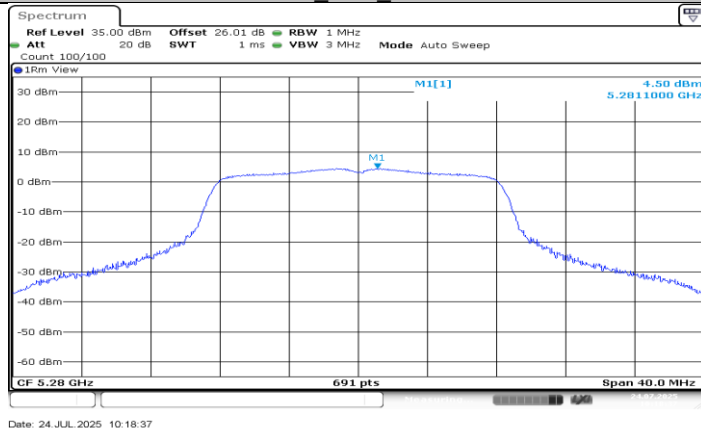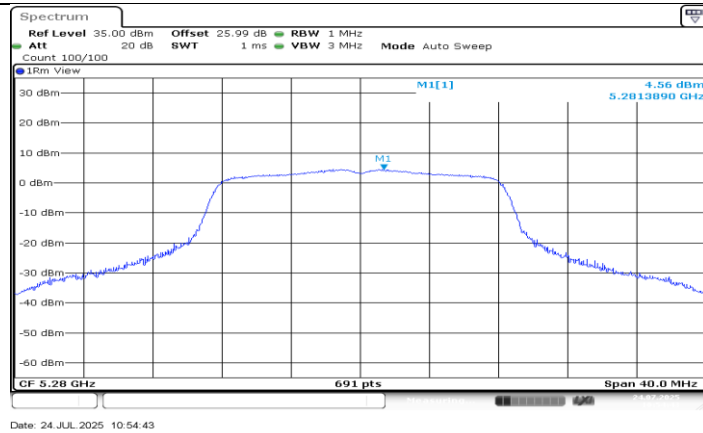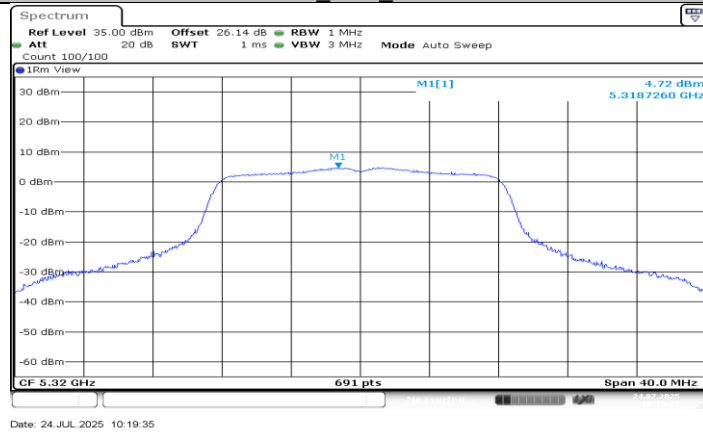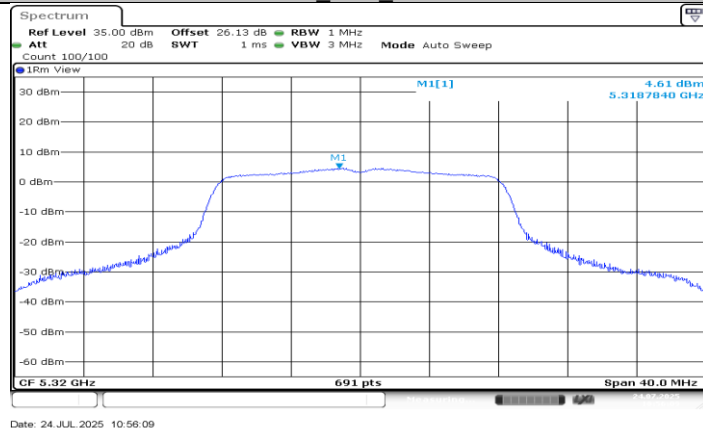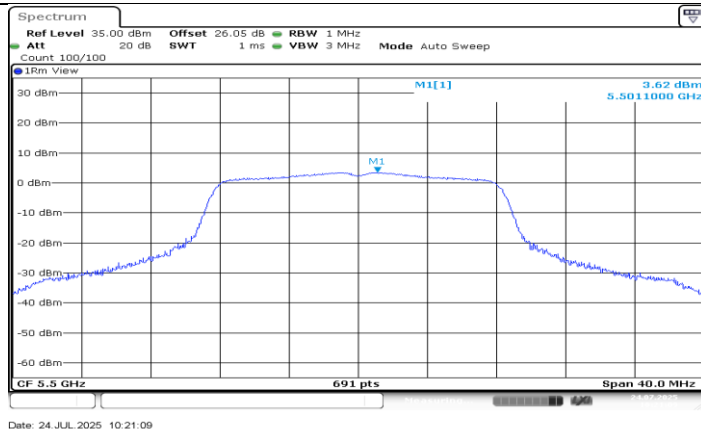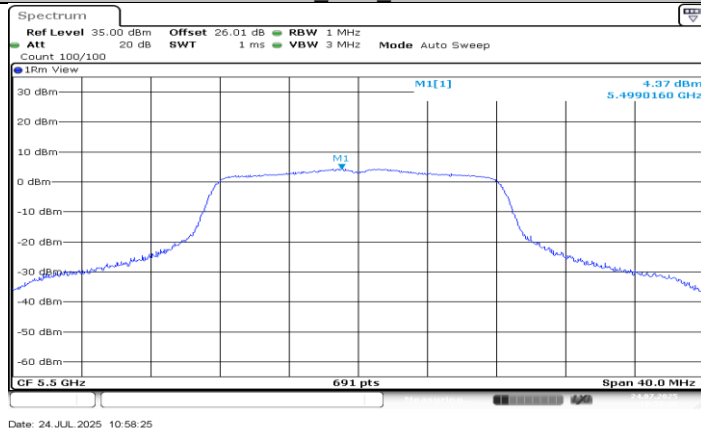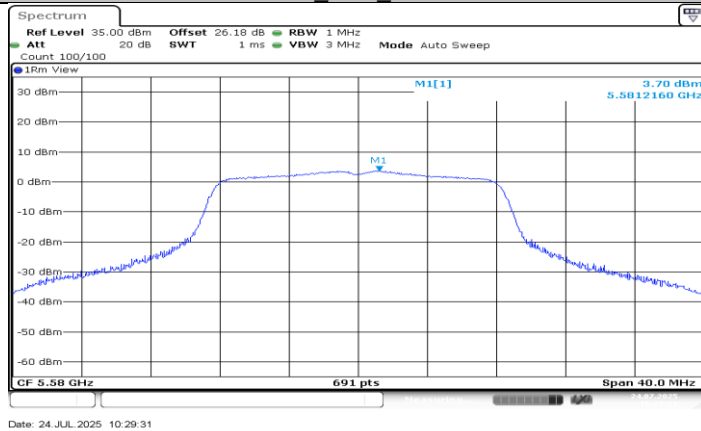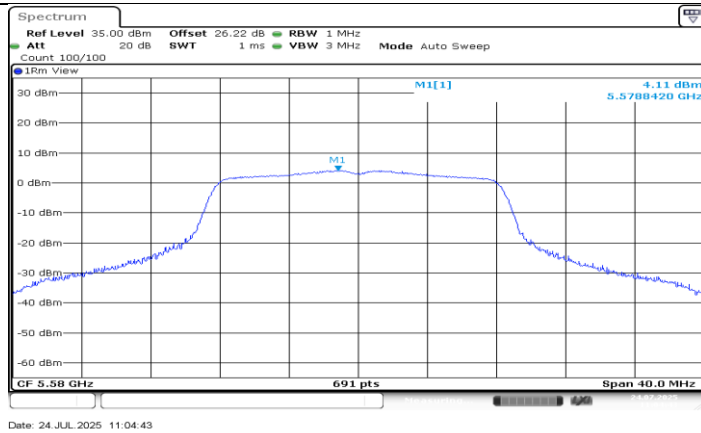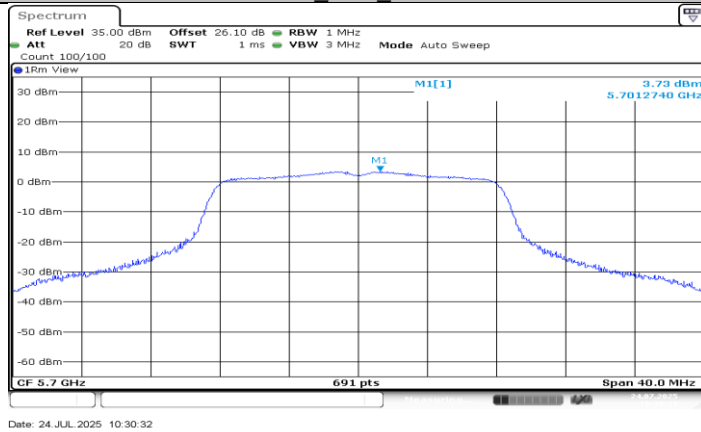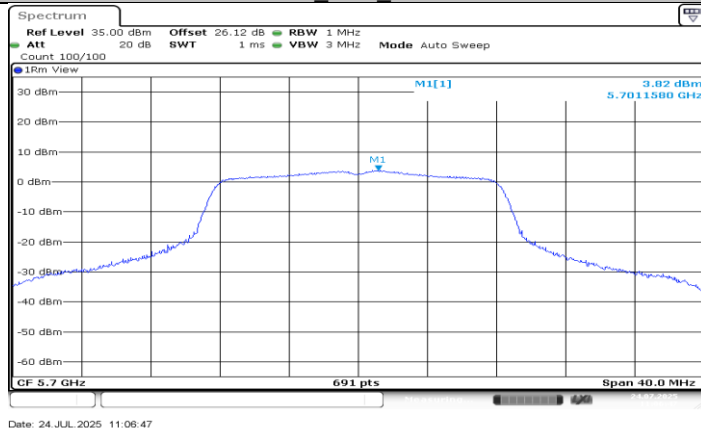
11A_Ant2_5200

11A_Ant1_5240

11A_Ant2_5240

11A_Ant1_5260

11A_Ant2_5260

11A_Ant1_5280

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11A_Ant2_5280

11A_Ant1_5320

11A_Ant2_5320

11A_Ant1_5500

11A_Ant2_5500

11A_Ant1_5580

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11A_Ant2_5580

11A_Ant1_5700

11A_Ant2_5700

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
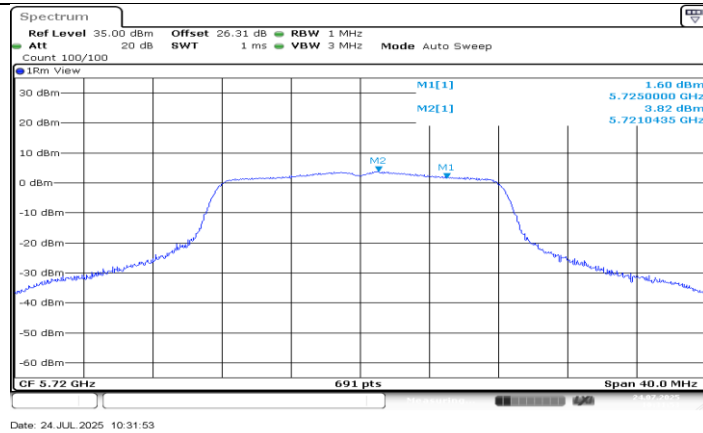
11A_Ant1_5720_UNII-2C
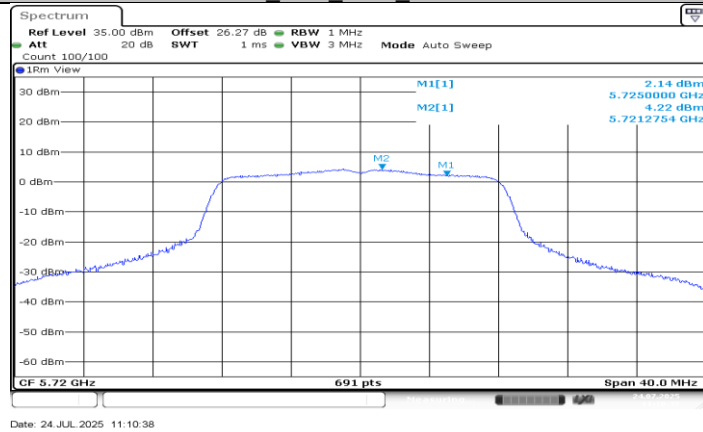
11A_Ant2_5720_UNII-2C

11A_Ant1_5720_UNII-3

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
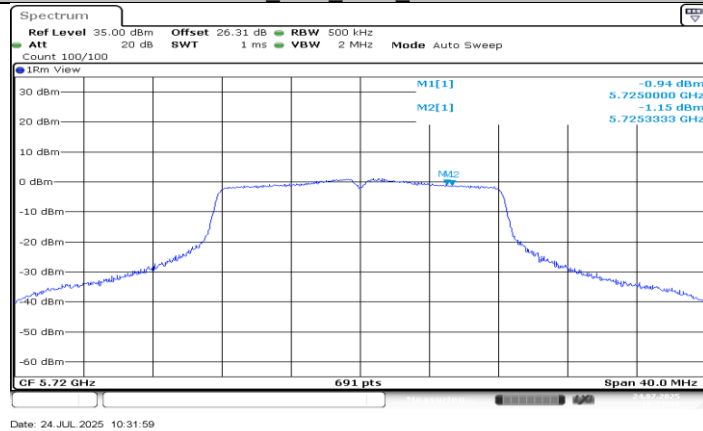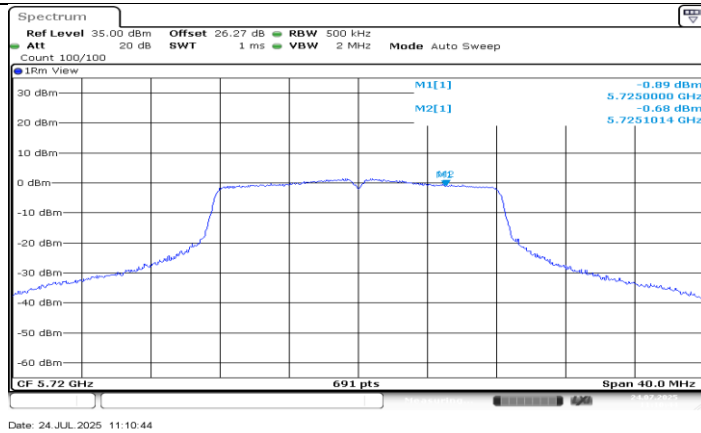
11A_Ant2_5720_UNII-3
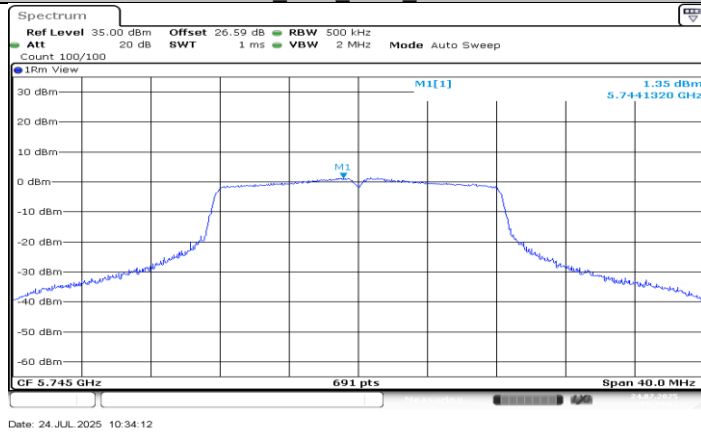
11A_Ant1_5745
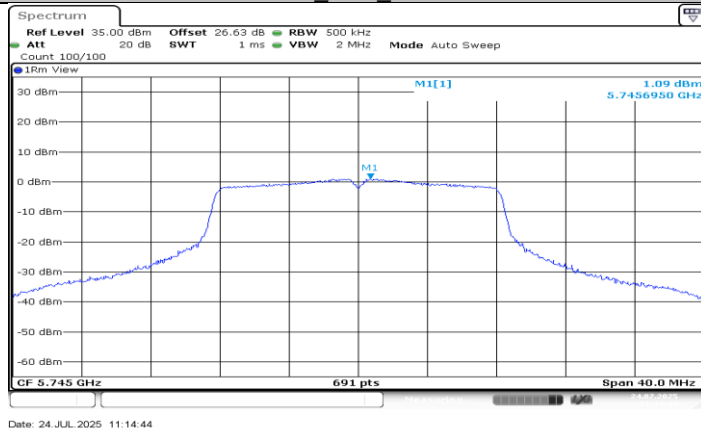
11A_Ant2_5745
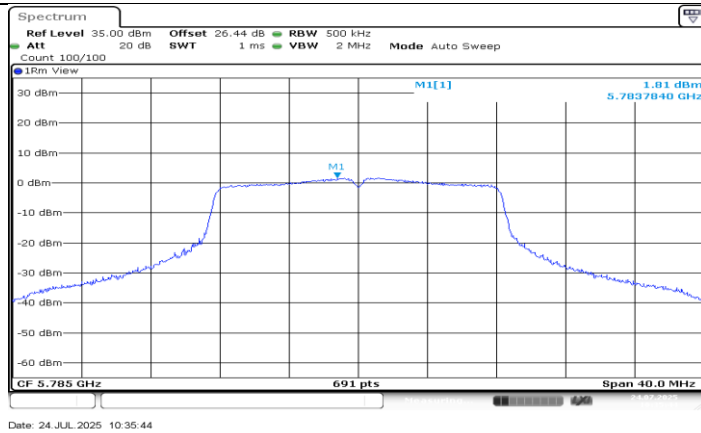
11A_Ant1_5785
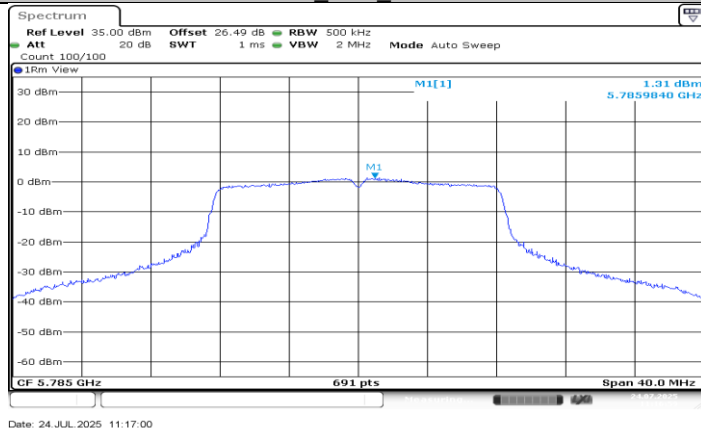
11A_Ant2_5785
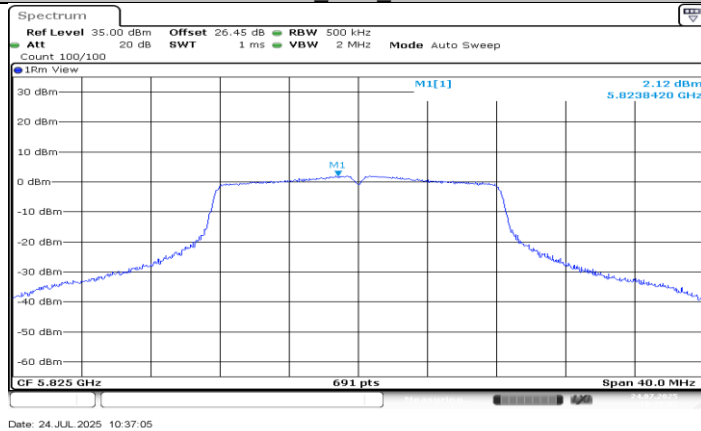
11A_Ant1_5825
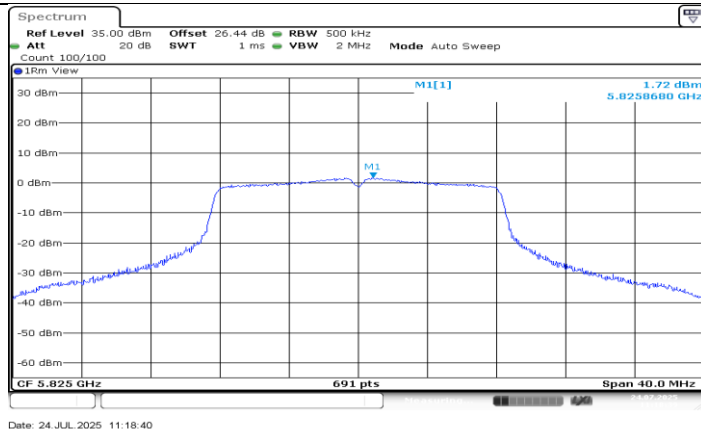
11A_Ant2_5825
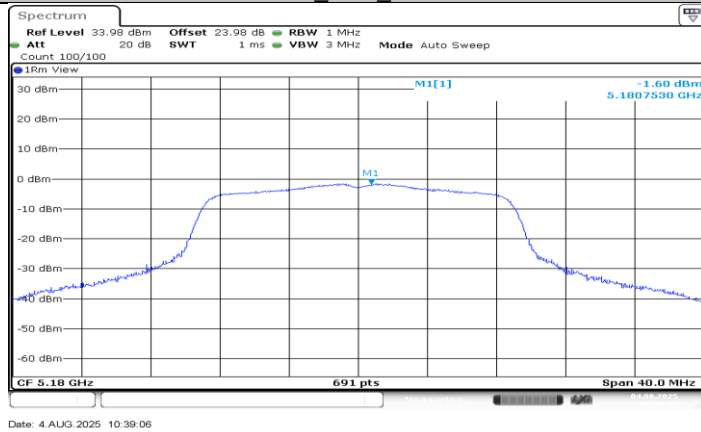
11N20MIMO_Ant1_5180

11N20MIMO_Ant2_5180

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
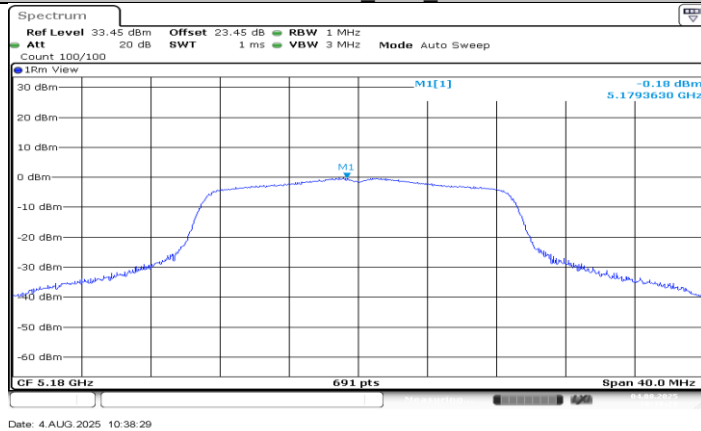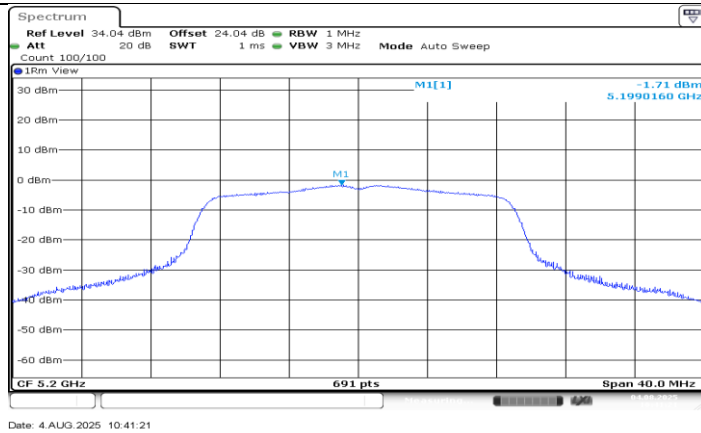
11N20MIMO_Ant1_5200
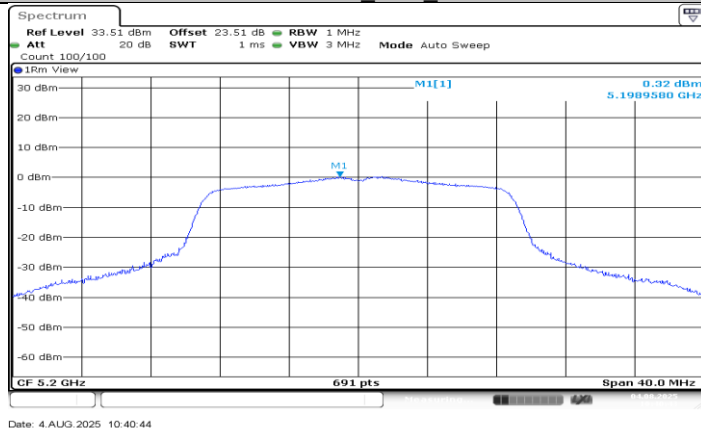
11N20MIMO_Ant2_5200
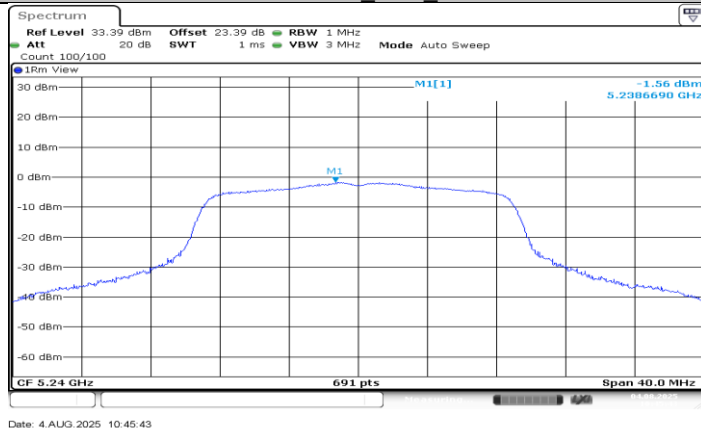
11N20MIMO_Ant1_5240
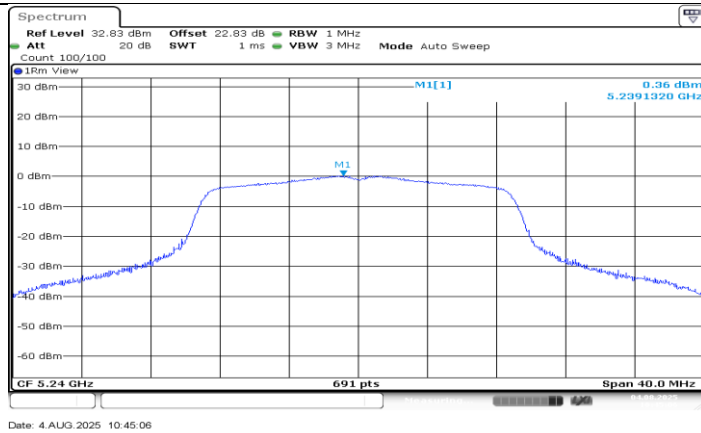
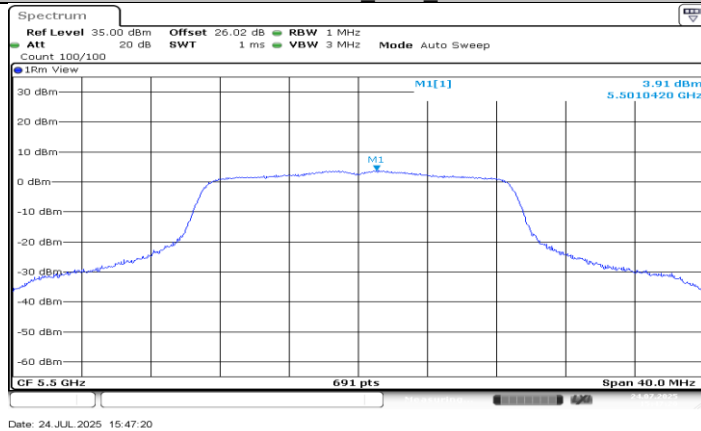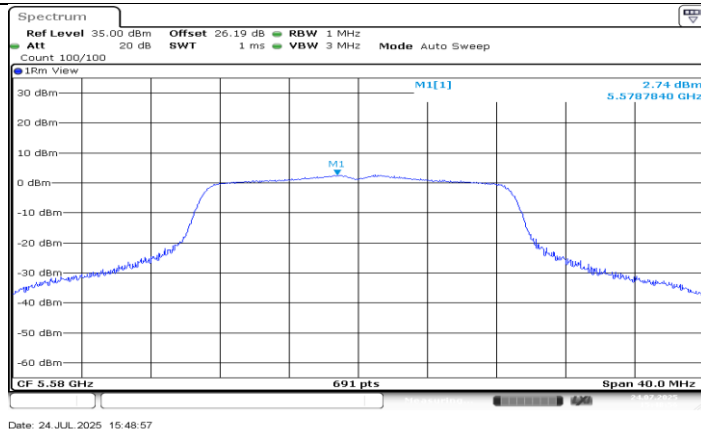11N20MIMO_Ant2_5240
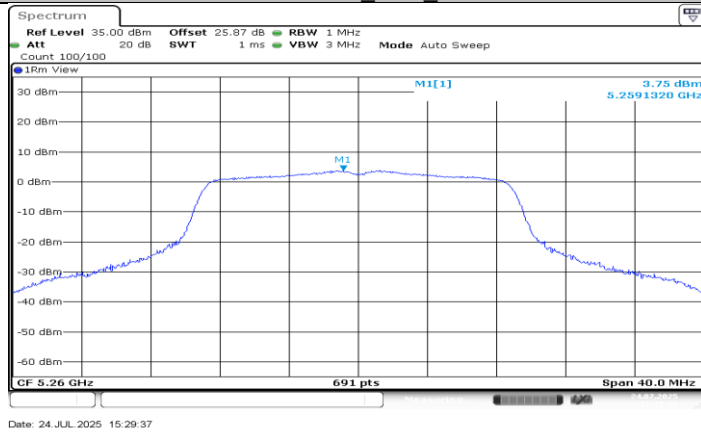
11N20MIMO_Ant1_5260

11N20MIMO_Ant2_5260

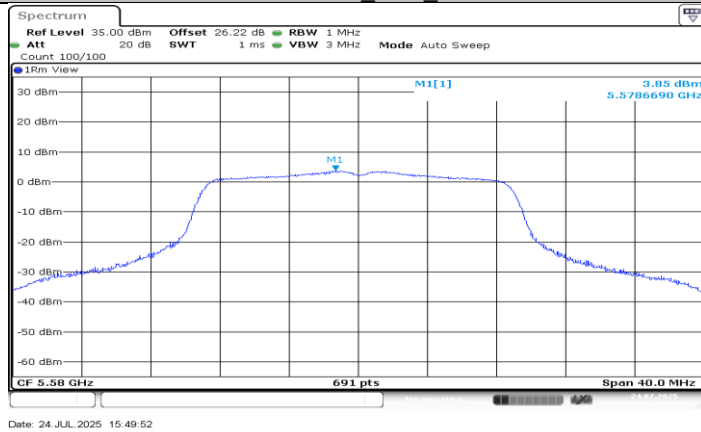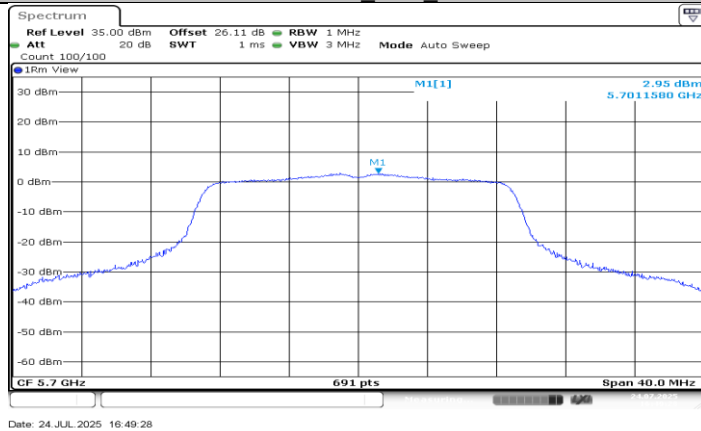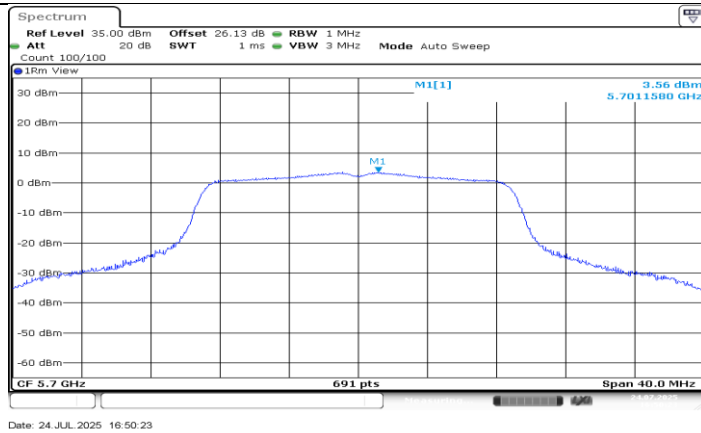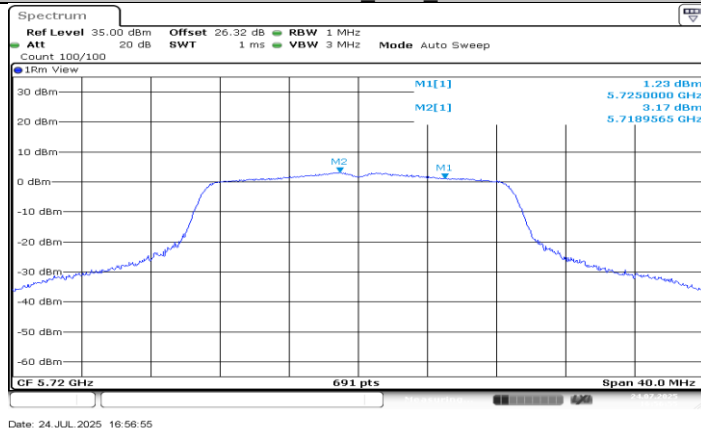UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
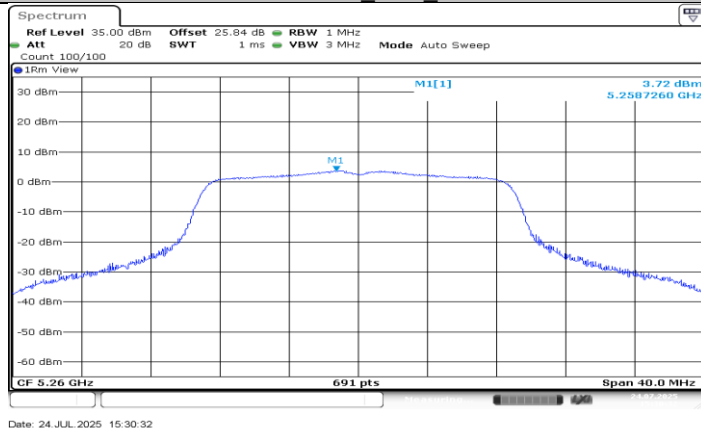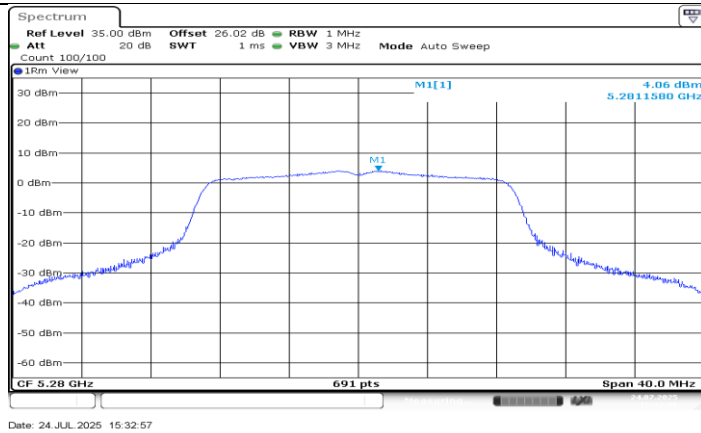
11N20MIMO_Ant1_5280
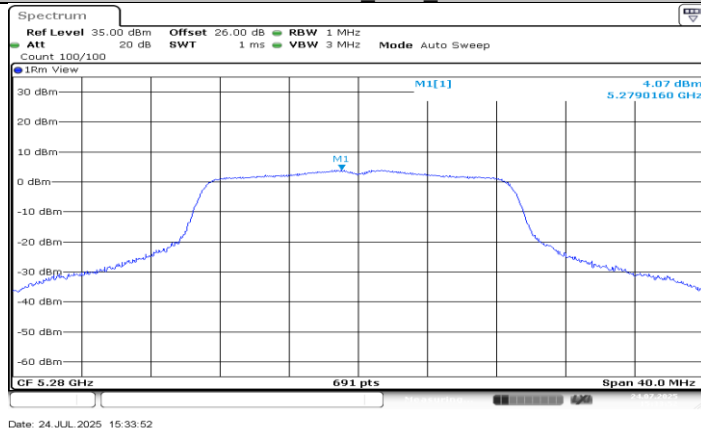
11N20MIMO_Ant2_5280
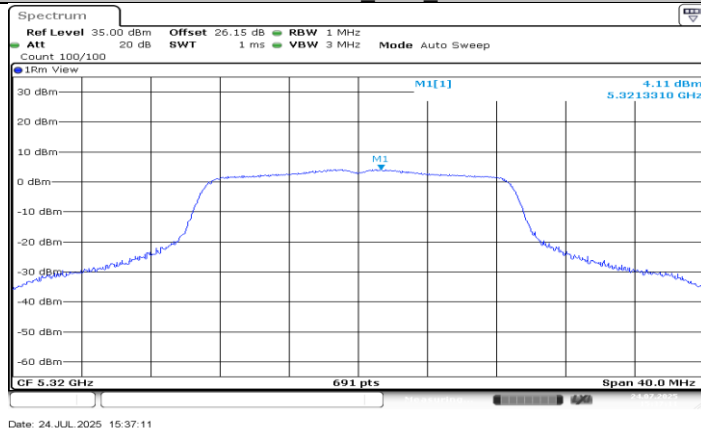
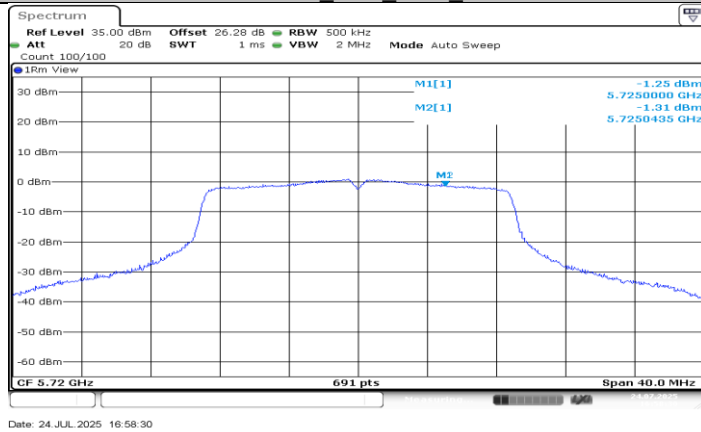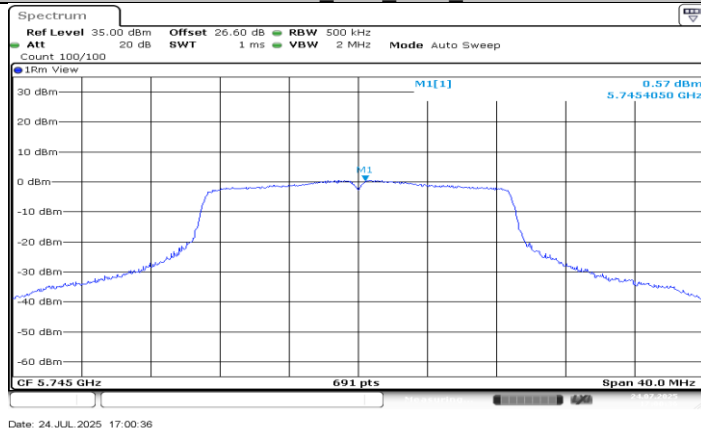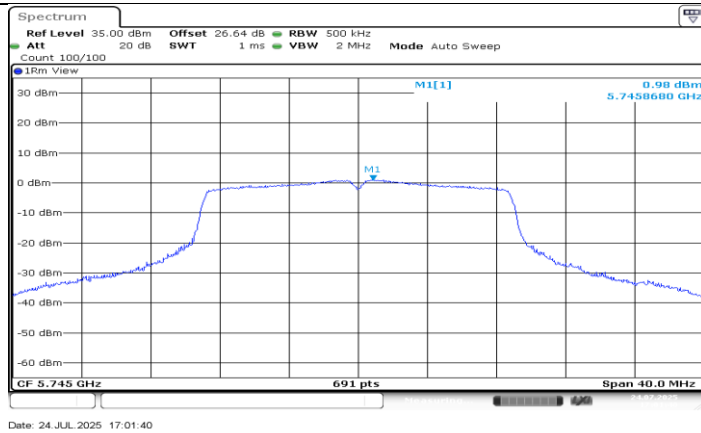11N20MIMO_Ant1_5320
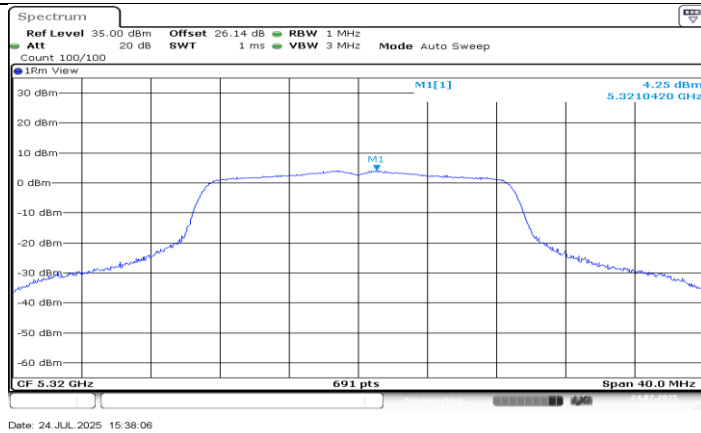
11N20MIMO_Ant2_5320
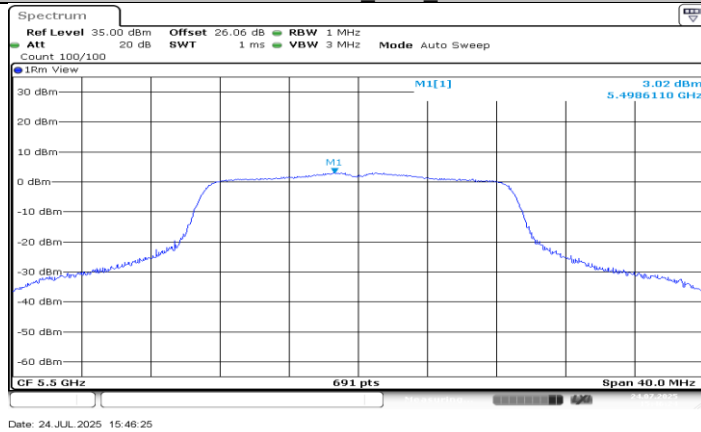
11N20MIMO_Ant1_5500

11N20MIMO_Ant2_5500

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11N20MIMO_Ant1_5580

11N20MIMO_Ant2_5580

11N20MIMO_Ant1_5700

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11N20MIMO_Ant2_5700
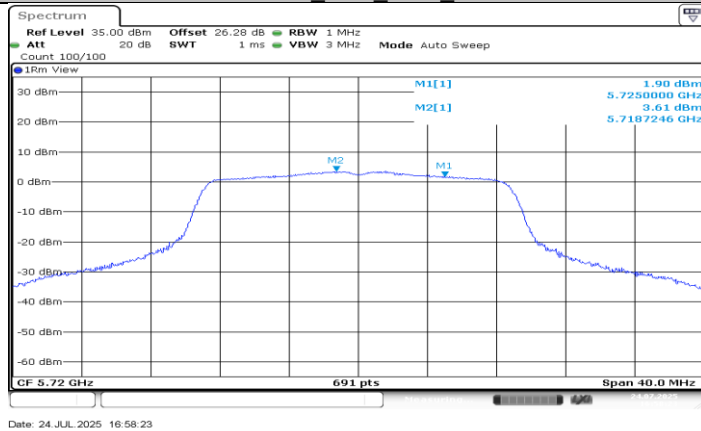
11N20MIMO_Ant1_5720_UNII-2C

11N20MIMO_Ant2_5720_UNII-2C

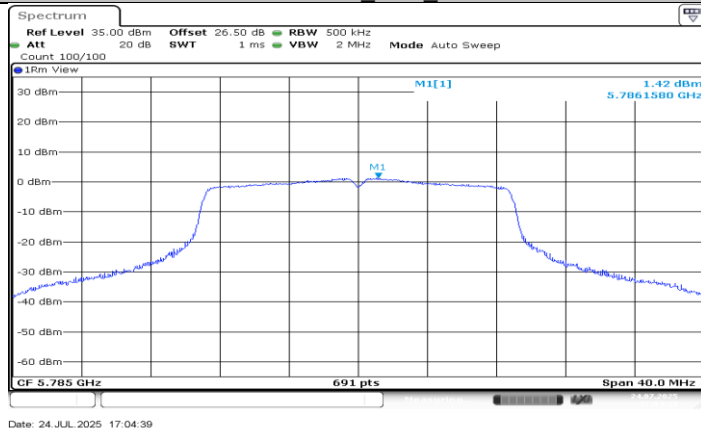UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
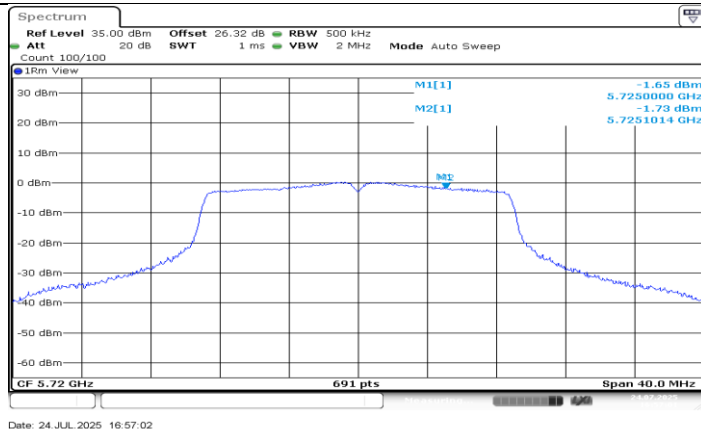
11N20MIMO_Ant1_5720_UNII-3
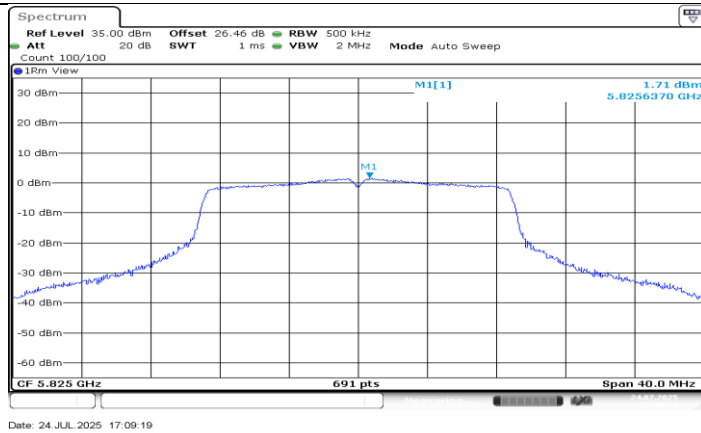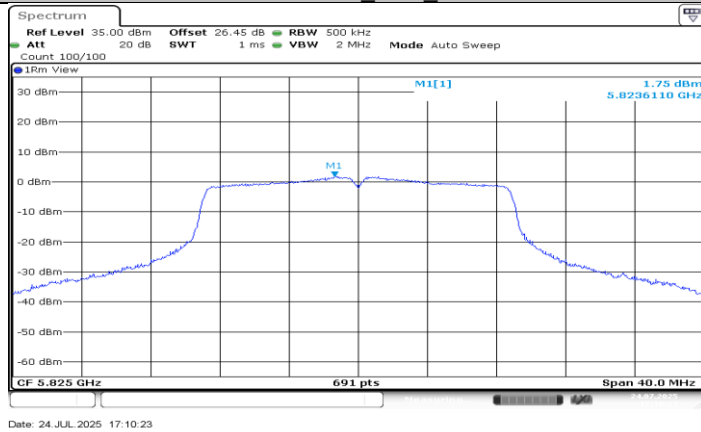

11N20MIMO_Ant2_5720_UNII-3

11N20MIMO_Ant1_5745

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11N20MIMO_Ant2_5745

11N20MIMO_Ant1_5785

11N20MIMO_Ant2_5785

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11N20MIMO_Ant1_5825

11N20MIMO_Ant2_5825

11N40MIMO_Ant1_5190

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
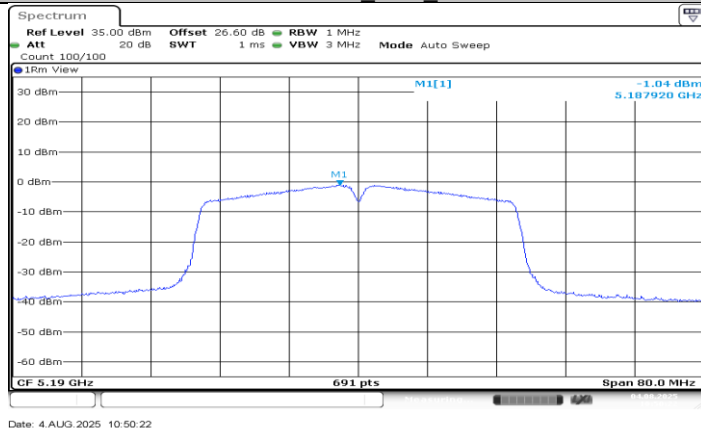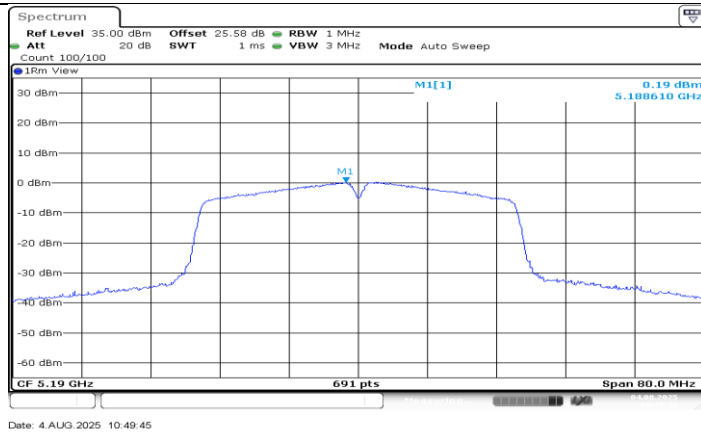
11N40MIMO_Ant2_5190

11N40MIMO_Ant1_5230

11N40MIMO_Ant2_5230

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11N40MIMO_Ant1_5270

11N40MIMO_Ant2_5270

11N40MIMO_Ant1_5310

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
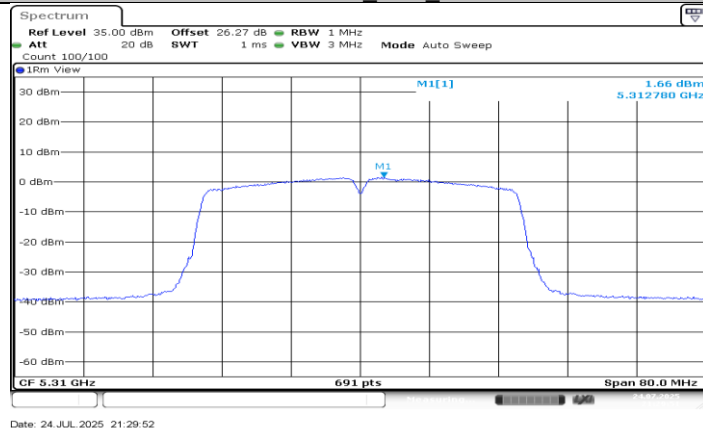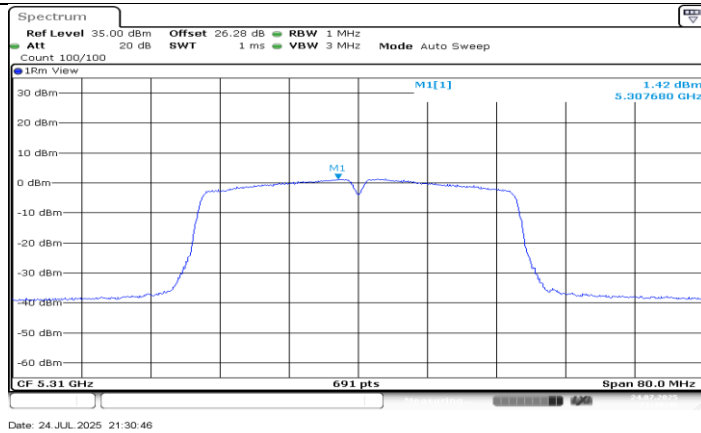
11N40MIMO_Ant2_5310
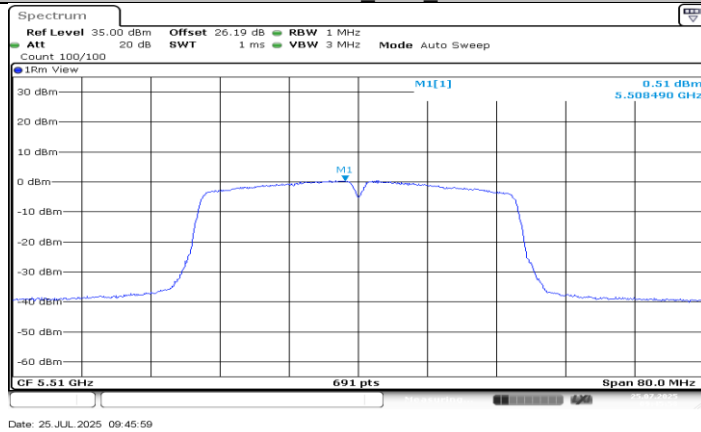
11N40MIMO_Ant1_5510

11N40MIMO_Ant2_5510

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
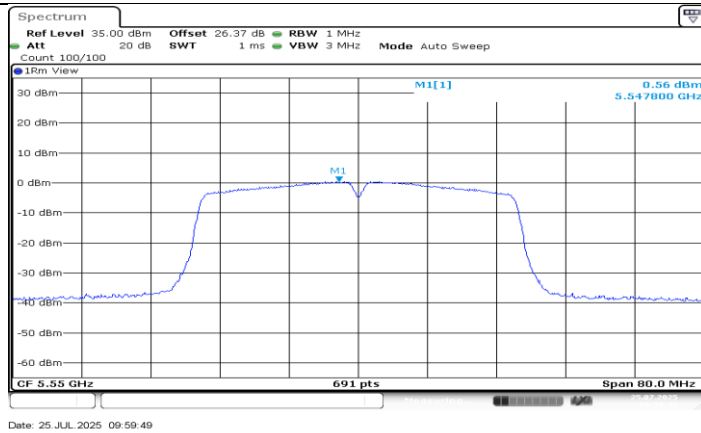
11N40MIMO_Ant1_5550
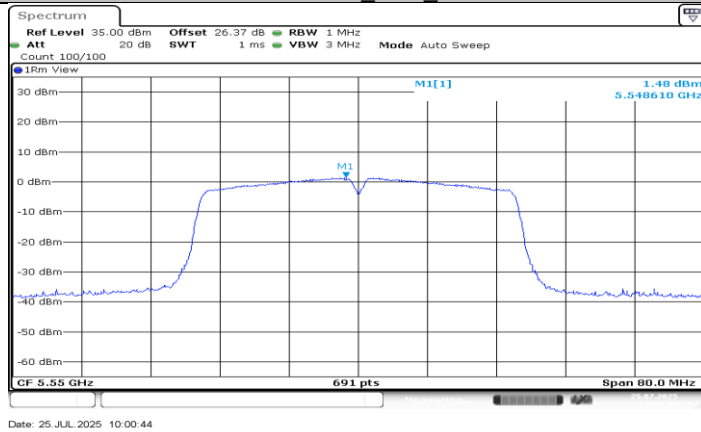
11N40MIMO_Ant2_5550

11N40MIMO_Ant1_5670

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

Date: 25.JUL.2025 10:15:00

11N40MIMO_Ant2_5670

Date: 25.JUL.2025 10:17:31

11N40MIMO_Ant1_5710_UNII-2C

Date: 25.JUL.2025 10:18:59

11N40MIMO_Ant2_5710_UNII-2C

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11N40MIMO_Ant1_5710_UNII-3

11N40MIMO_Ant2_5710_UNII-3

11N40MIMO_Ant1_5755

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
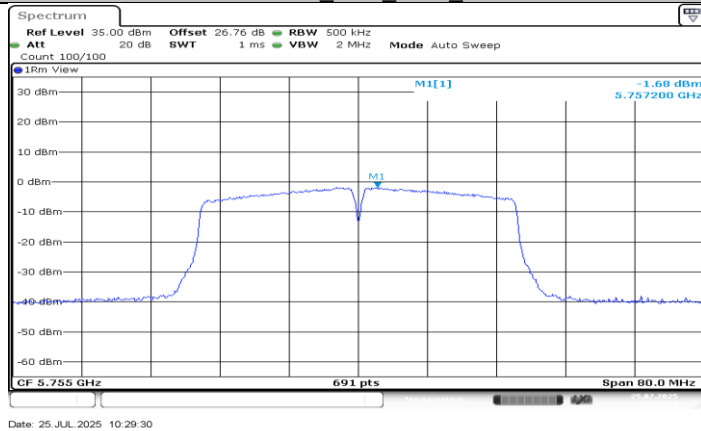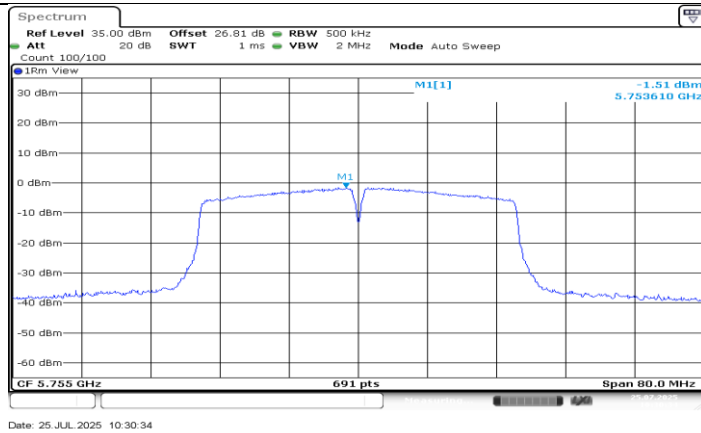
11N40MIMO_Ant2_5755
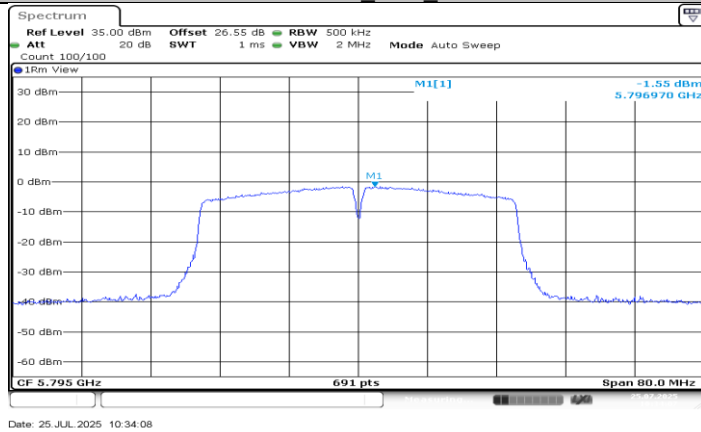
11N40MIMO_Ant1_5795

11N40MIMO_Ant2_5795

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
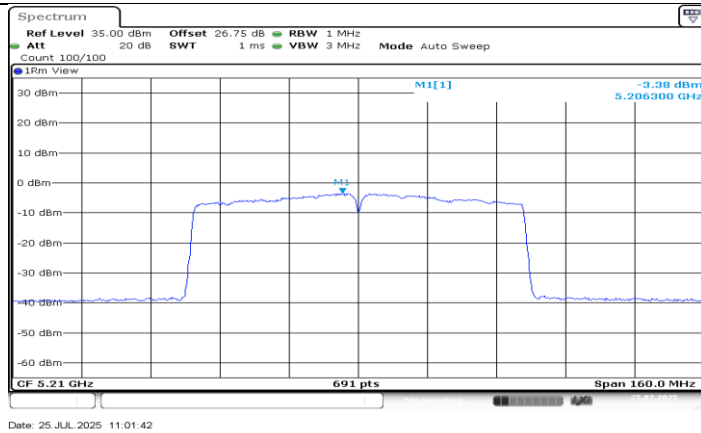
11AC80MIMO_Ant1_5210
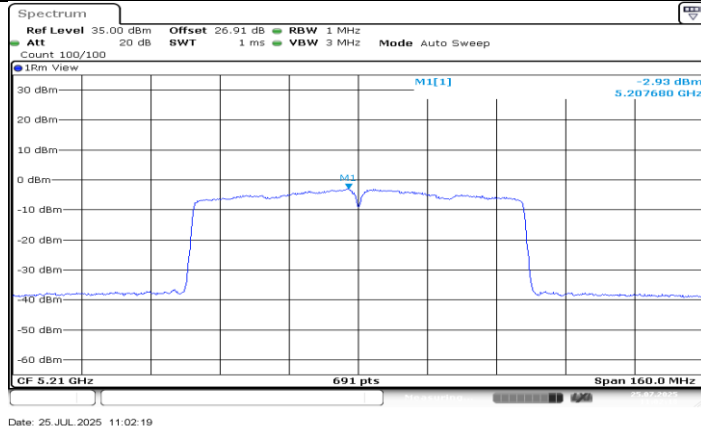
11AC80MIMO_Ant2_5210

11AC80MIMO_Ant1_5290

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
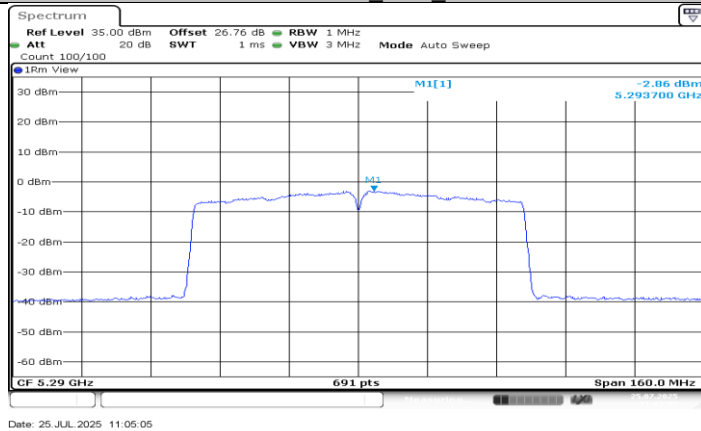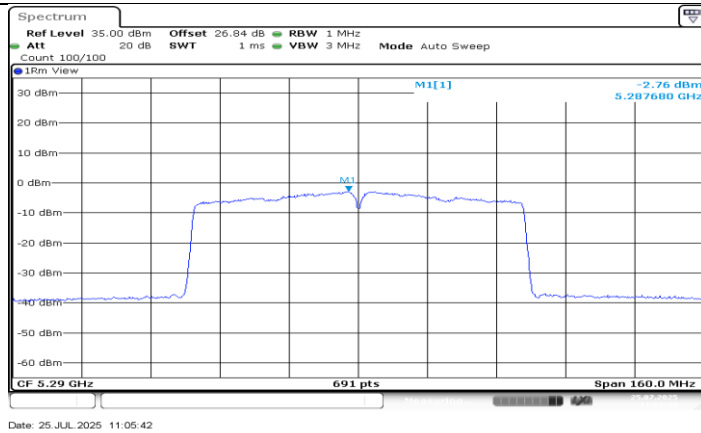
11AC80MIMO_Ant2_5290
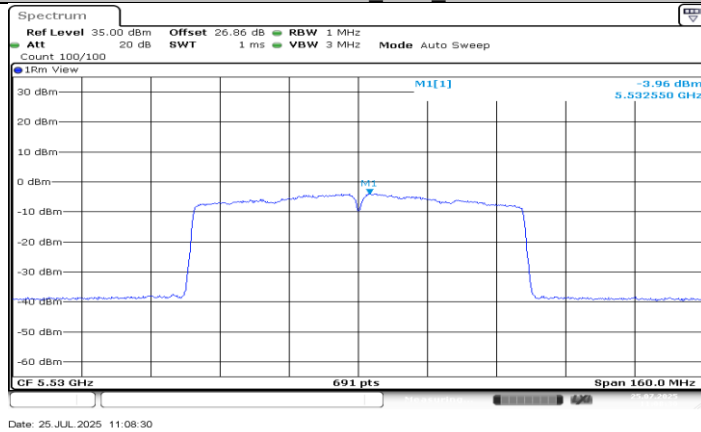
11AC80MIMO_Ant1_5530
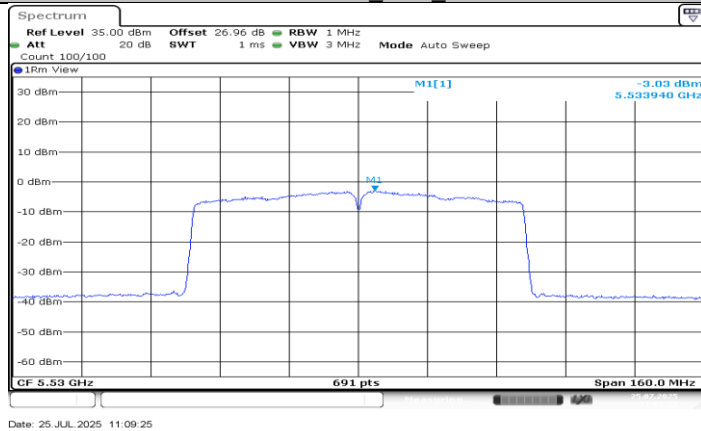
11AC80MIMO_Ant2_5530
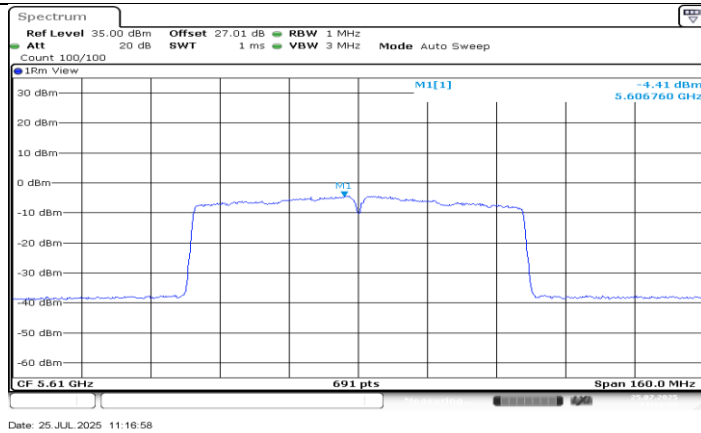
11AC80MIMO_Ant1_5610
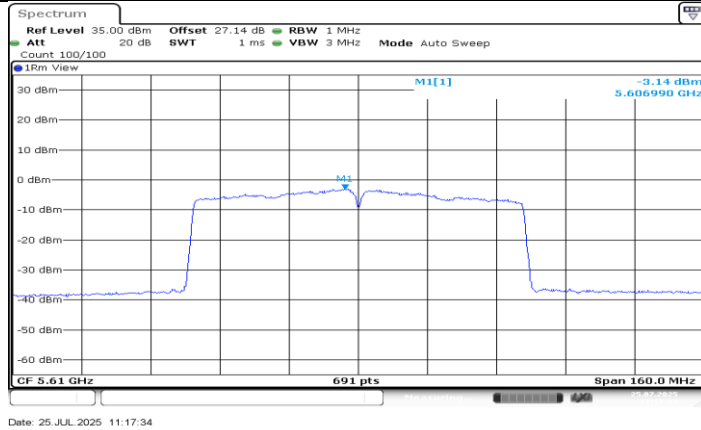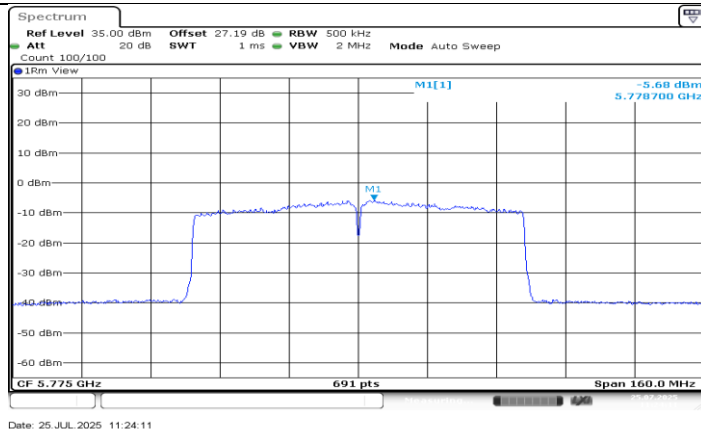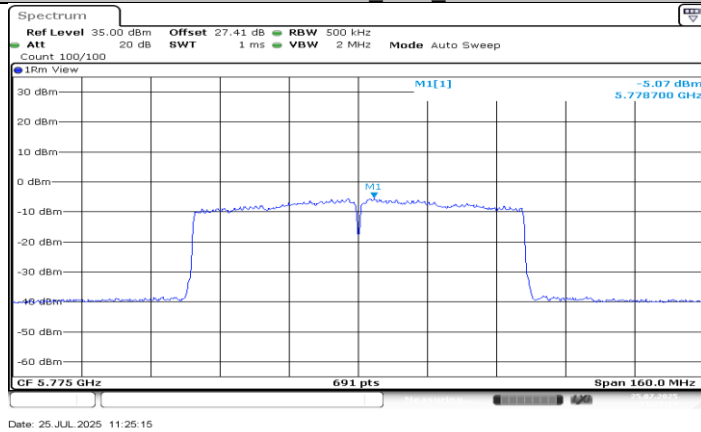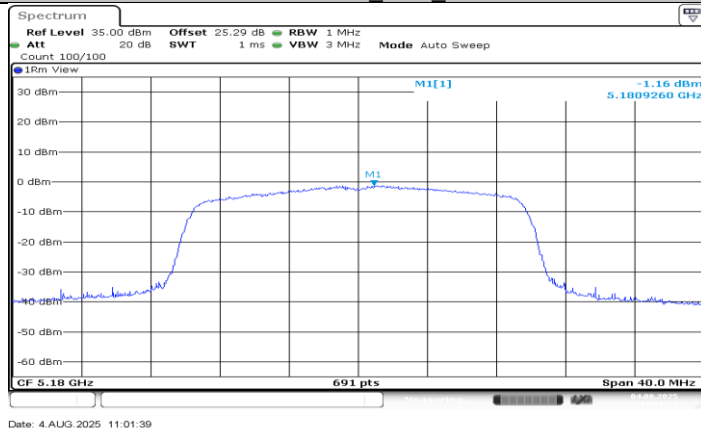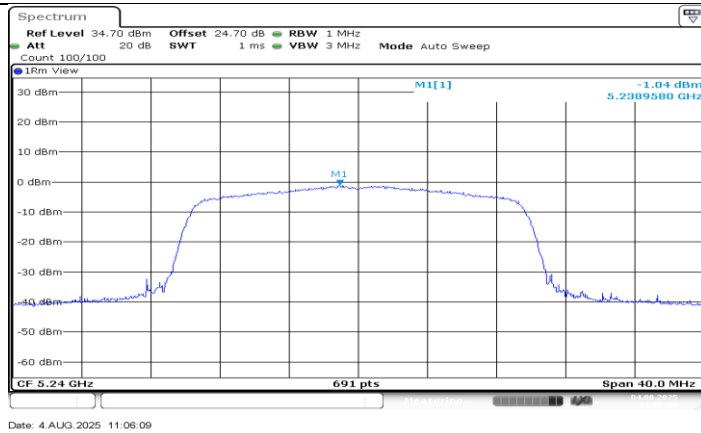

11AC80MIMO_Ant2_5610

11AC80MIMO_Ant1_5690_UNII-2C

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

Date: 25.JUL.2025 11:22:05

11AC80MIMO_Ant2_5690_UNII-2C

Date: 25.JUL.2025 11:20:43

11AC80MIMO_Ant1_5690_UNII-3

Date: 25.JUL.2025 11:22:12

11AC80MIMO_Ant2_5690_UNII-3

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11AC80MIMO_Ant1_5775

11AC80MIMO_Ant2_5775

11AX20MIMO_Ant1_5180

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
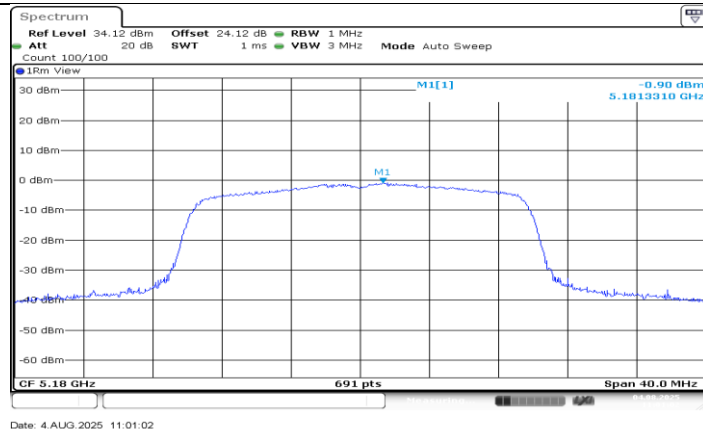
11AX20MIMO_Ant2_5180
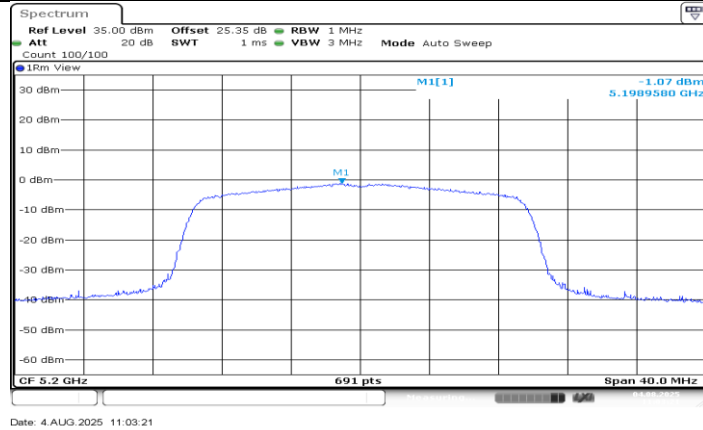
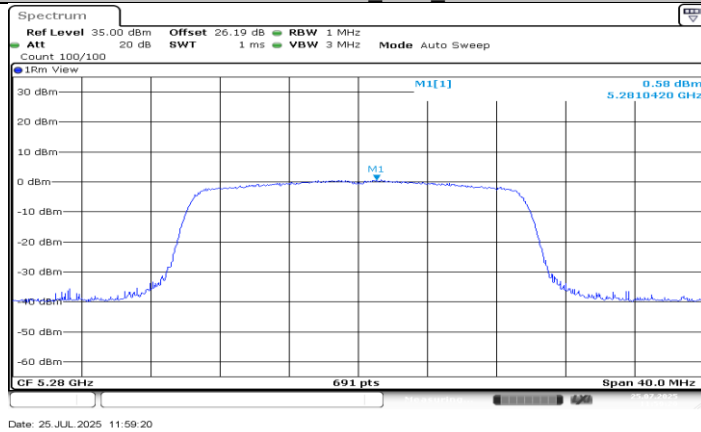11AX20MIMO_Ant1_5200
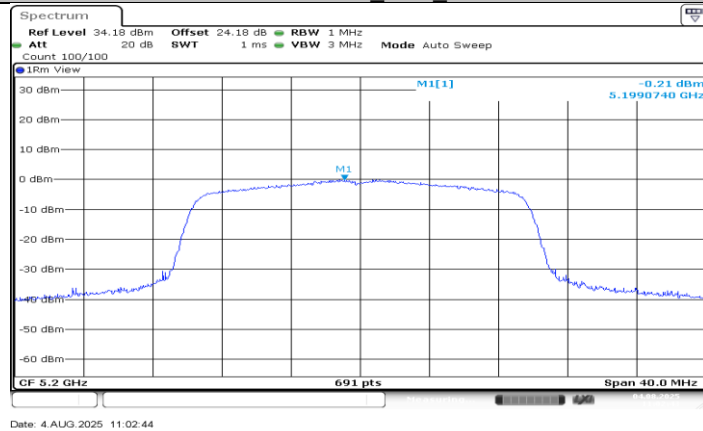
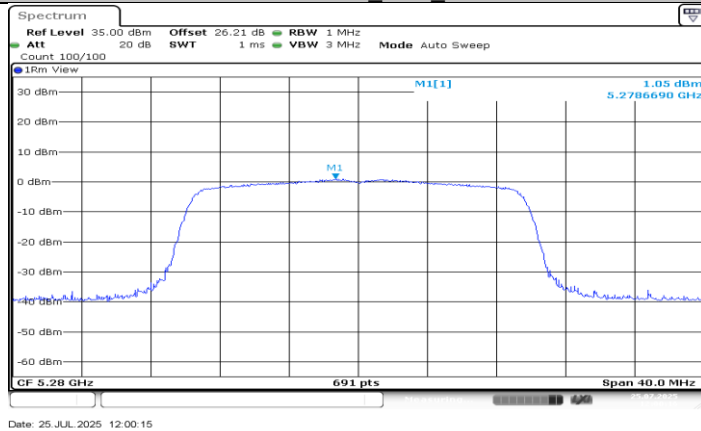11AX20MIMO_Ant2_5200

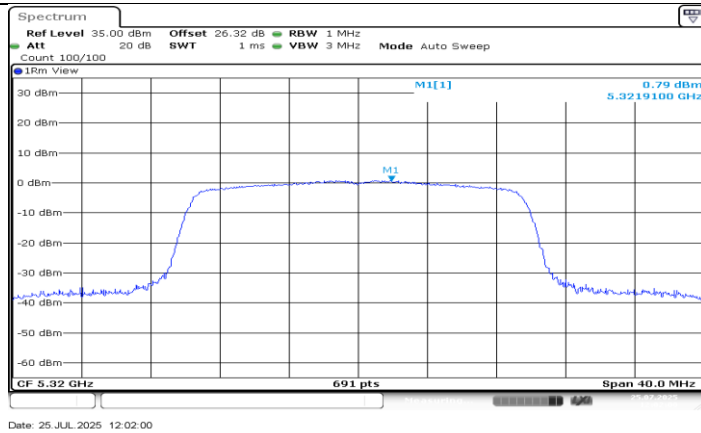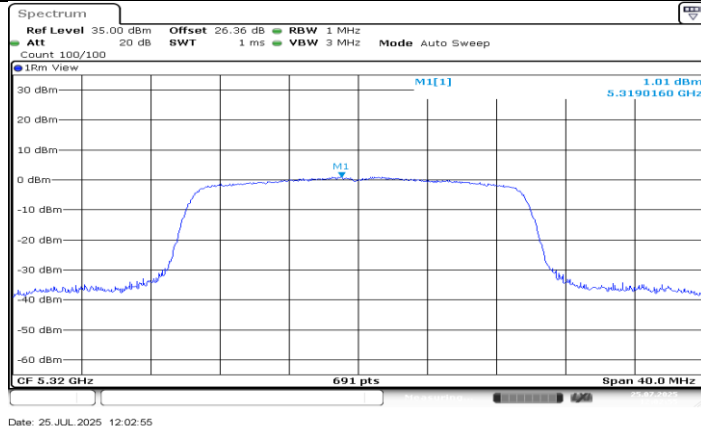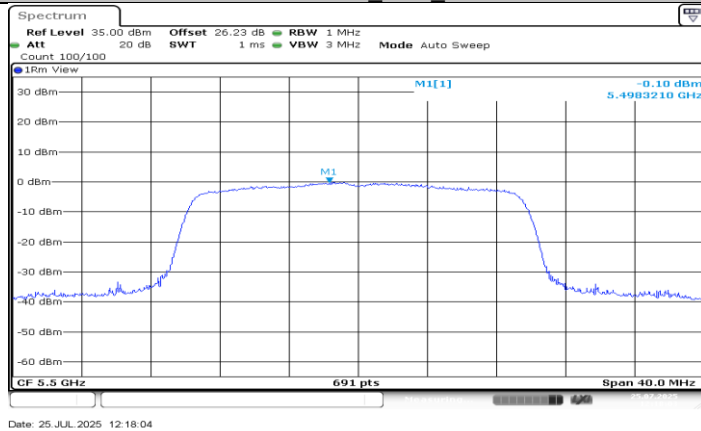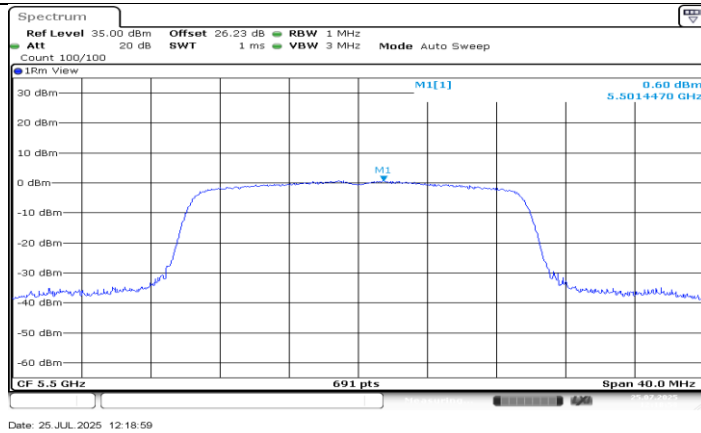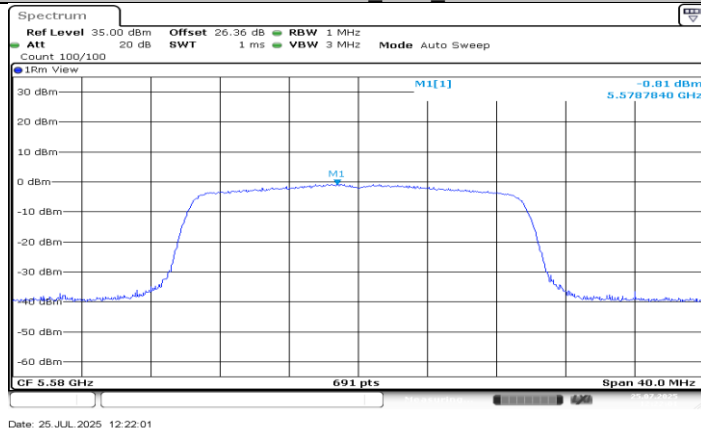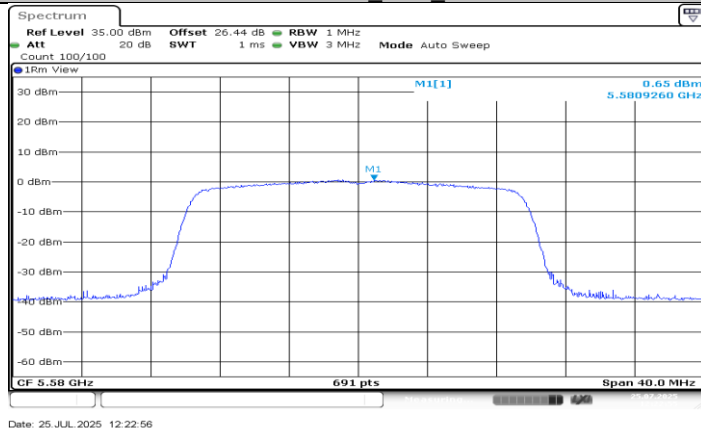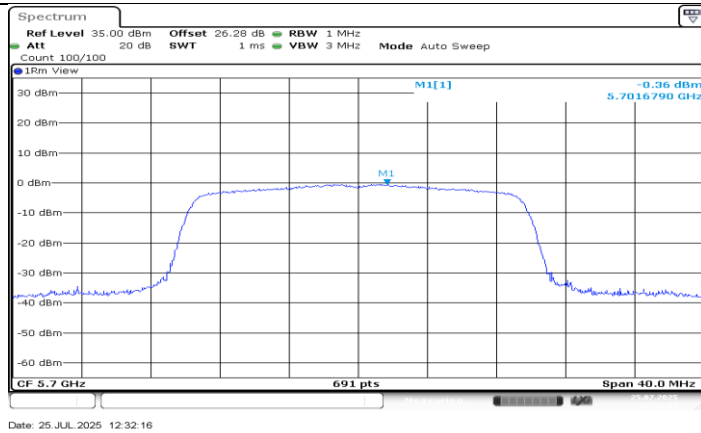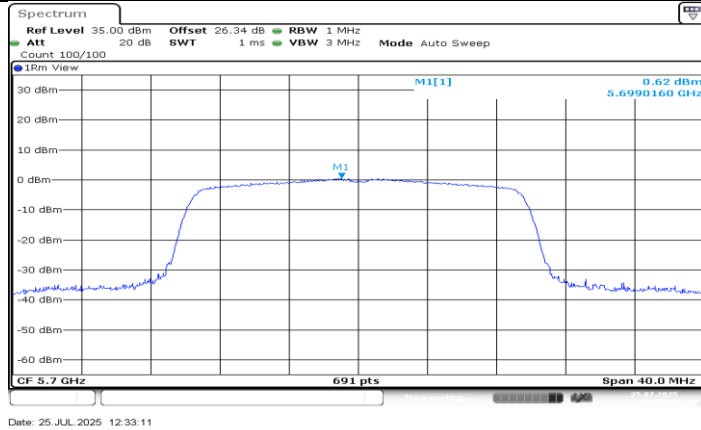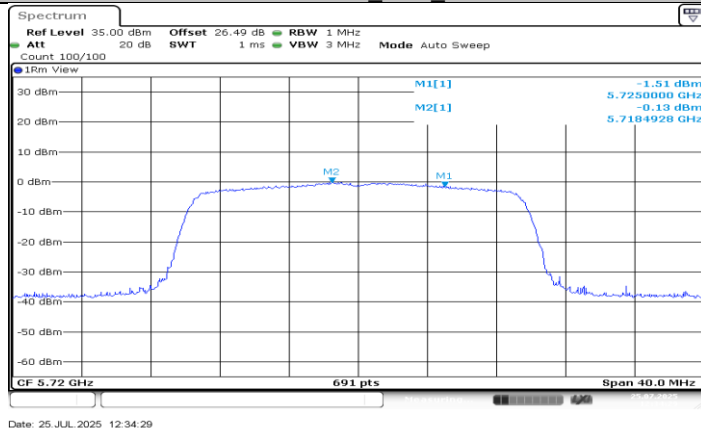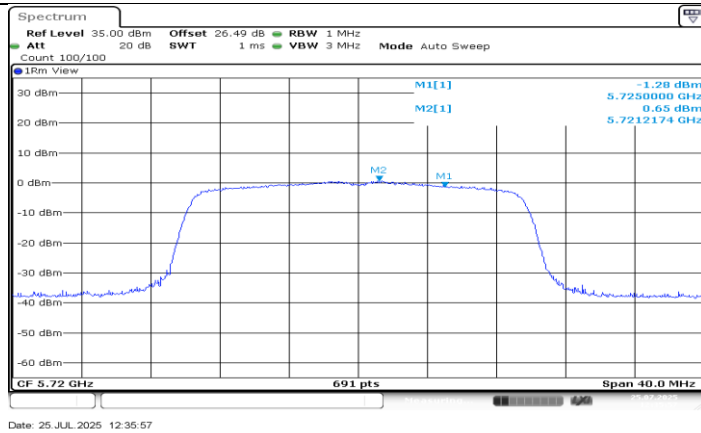11AX20MIMO_Ant1_5240
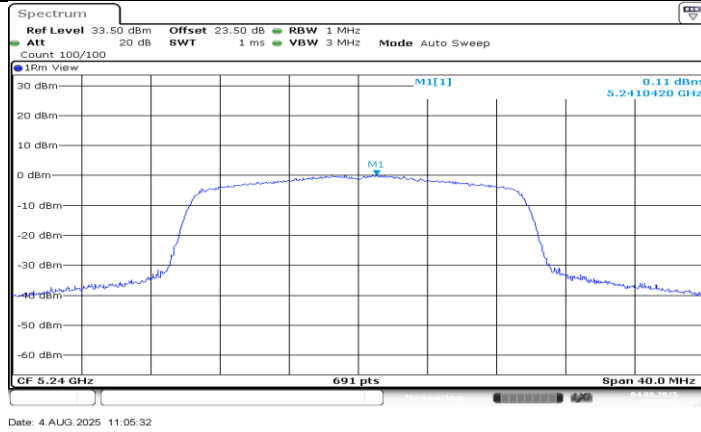
11AX20MIMO_Ant2_5240

11AX20MIMO_Ant1_5260

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

Date: 25.JUL.2025 11:56:08

11AX20MIMO_Ant2_5260

Date: 25.JUL.2025 11:59:20
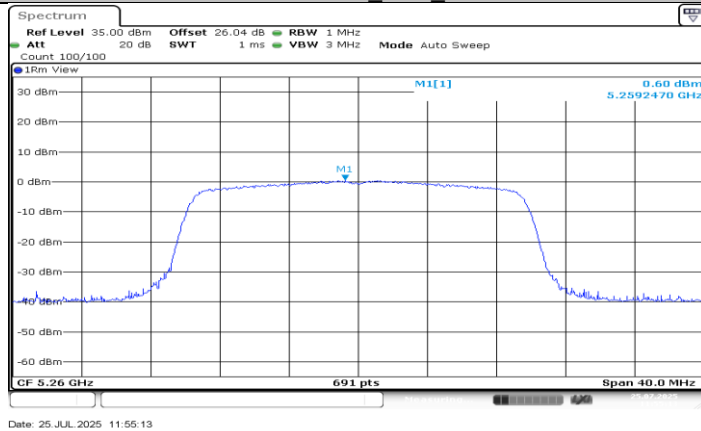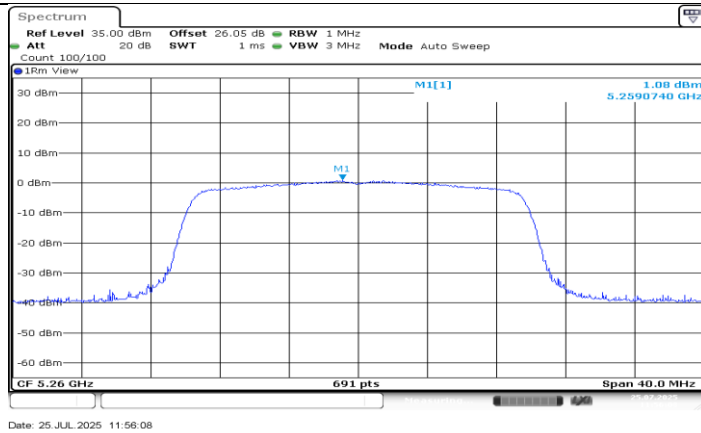
11AX20MIMO_Ant1_5280

Date: 25.JUL.2025 12:00:15

11AX20MIMO_Ant2_5280

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11AX20MIMO_Ant1_5320

11AX20MIMO_Ant2_5320

11AX20MIMO_Ant1_5500

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11AX20MIMO_Ant2_5500

11AX20MIMO_Ant1_5580
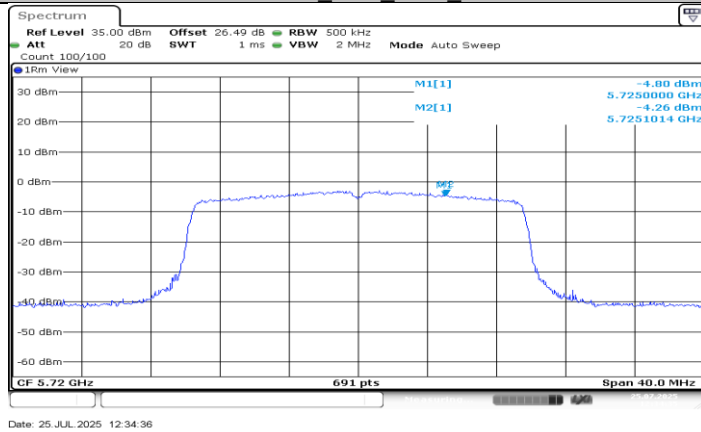

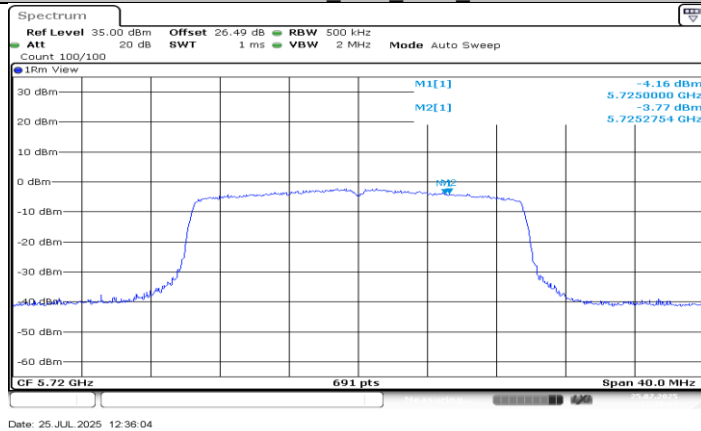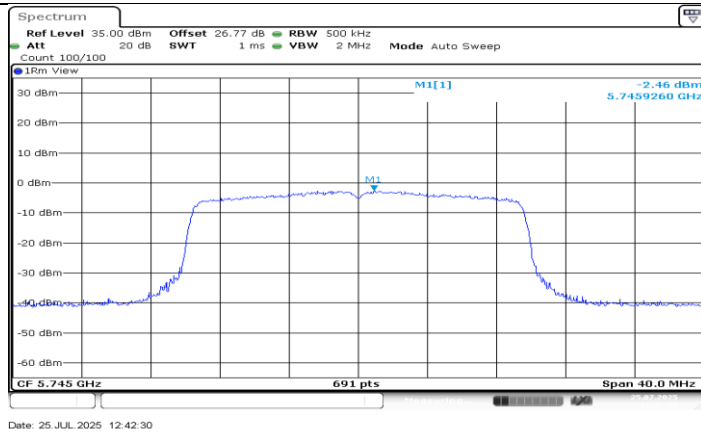11AX20MIMO_Ant2_5580

11AX20MIMO_Ant1_5700
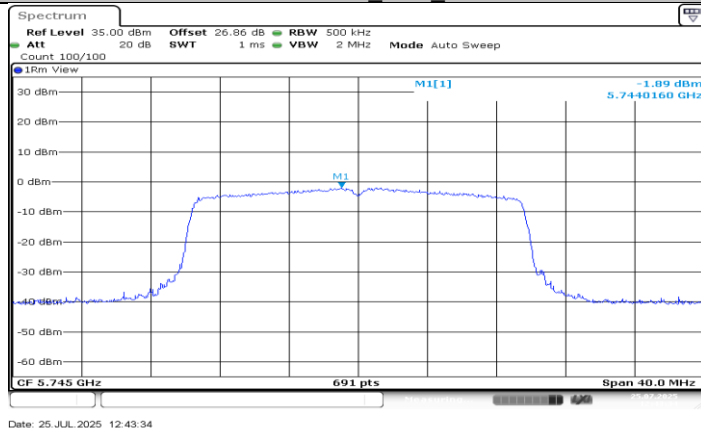

11AX20MIMO_Ant2_5700

11AX20MIMO_Ant1_5720_UNII-2C

11AX20MIMO_Ant2_5720_UNII-2C
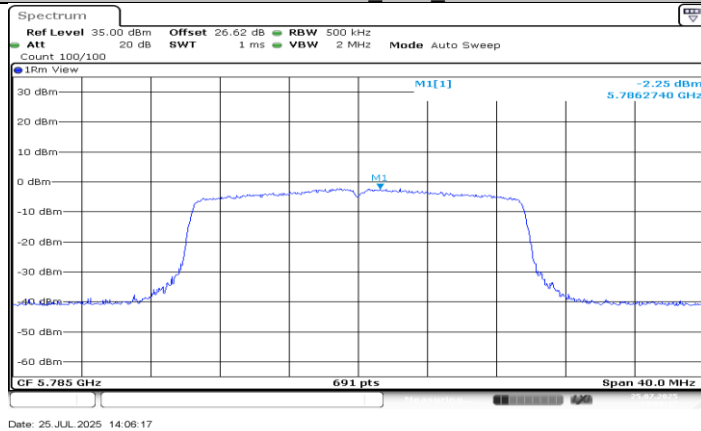

11AX20MIMO_Ant1_5720_UNII-3
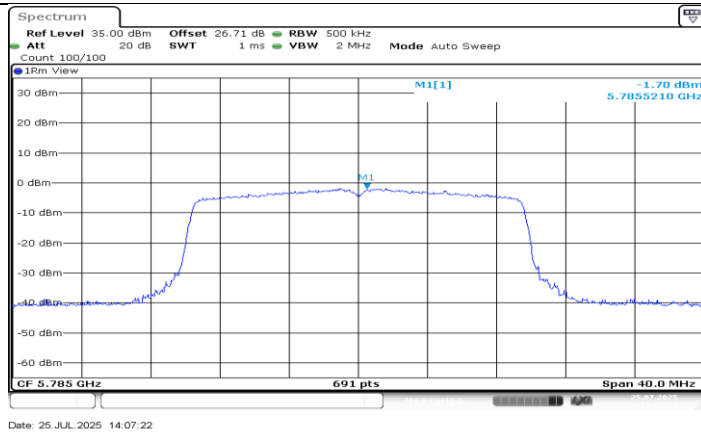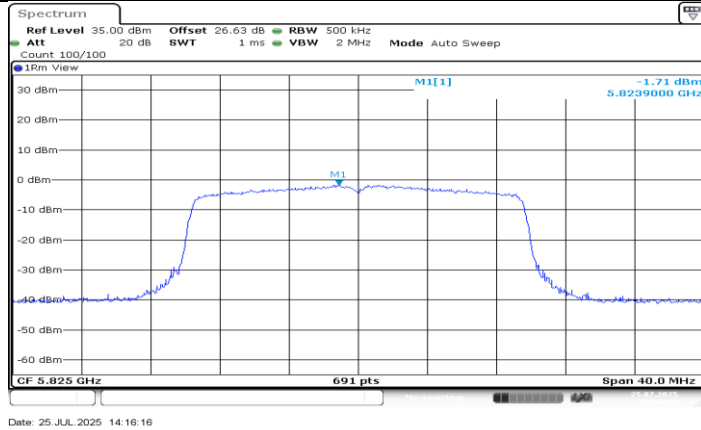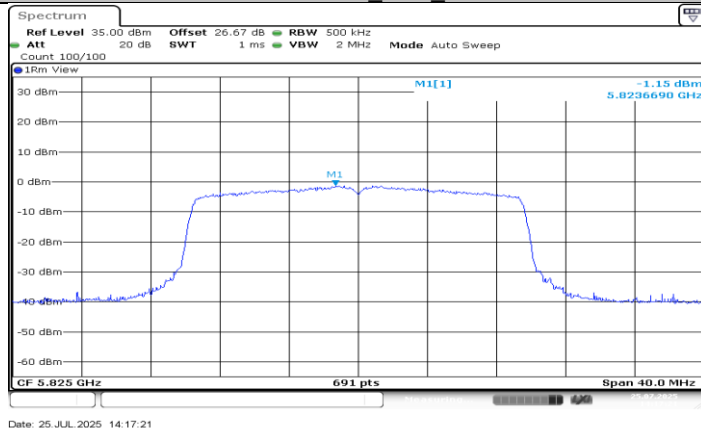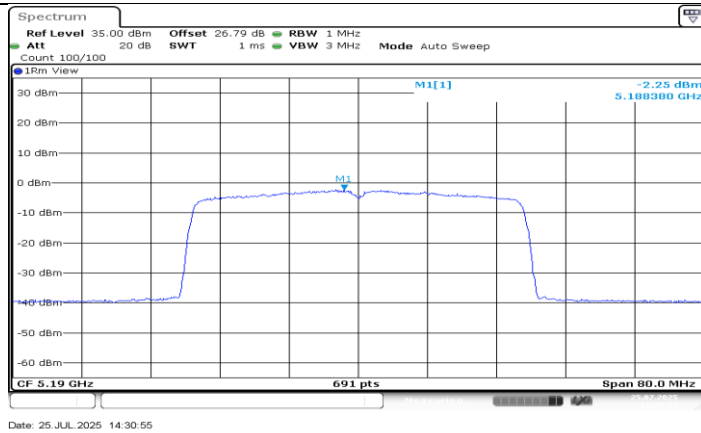

11AX20MIMO_Ant2_5720_UNII-3

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11AX20MIMO_Ant1_5745

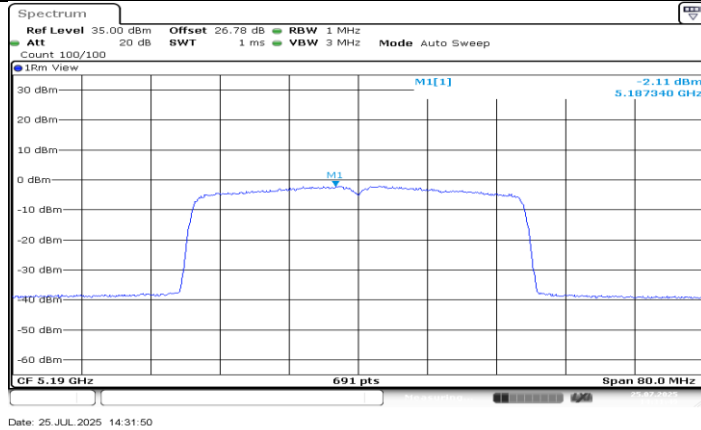11AX20MIMO_Ant2_5745

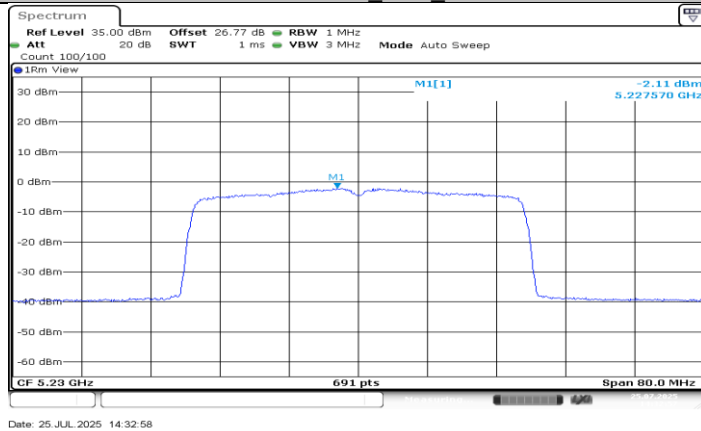11AX20MIMO_Ant1_5785

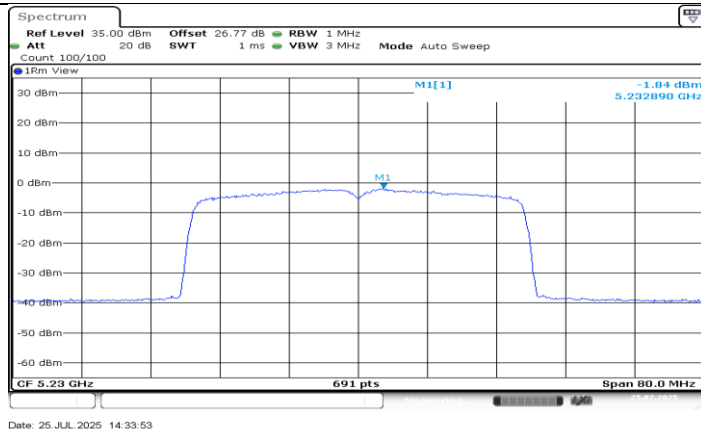11AX20MIMO_Ant2_5785

11AX20MIMO_Ant1_5825

11AX20MIMO_Ant2_5825

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.
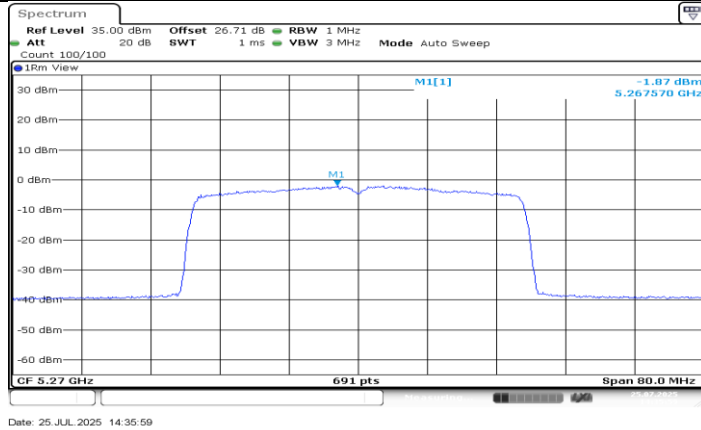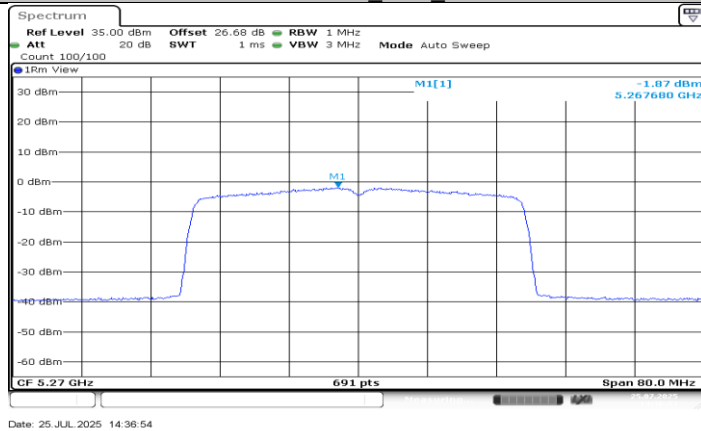
11AX40MIMO_Ant1_5190
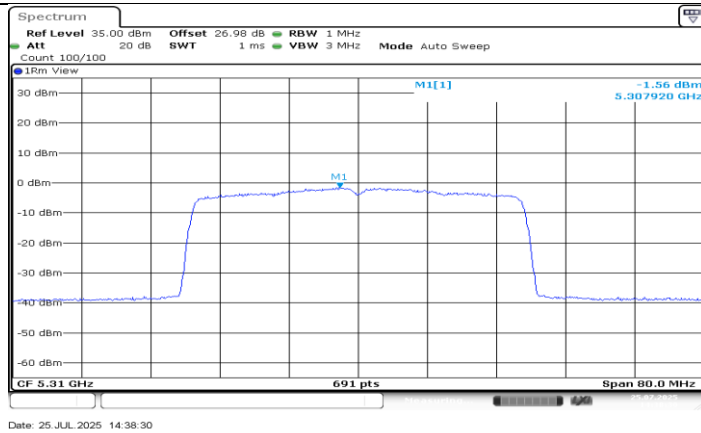

11AX40MIMO_Ant2_5190

11AX40MIMO_Ant1_5230

11AX40MIMO_Ant2_5230
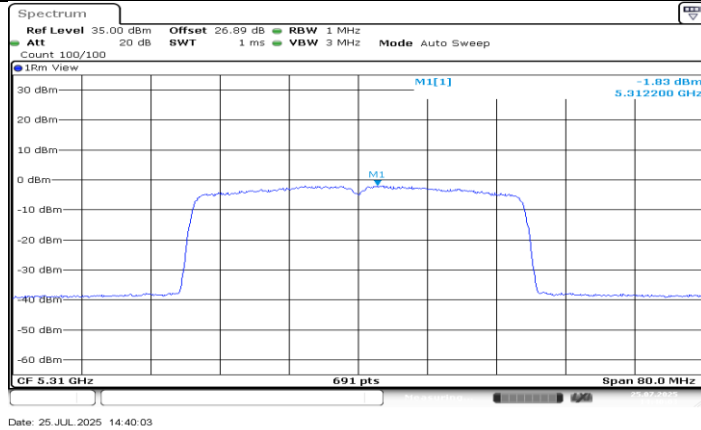

11AX40MIMO_Ant1_5270
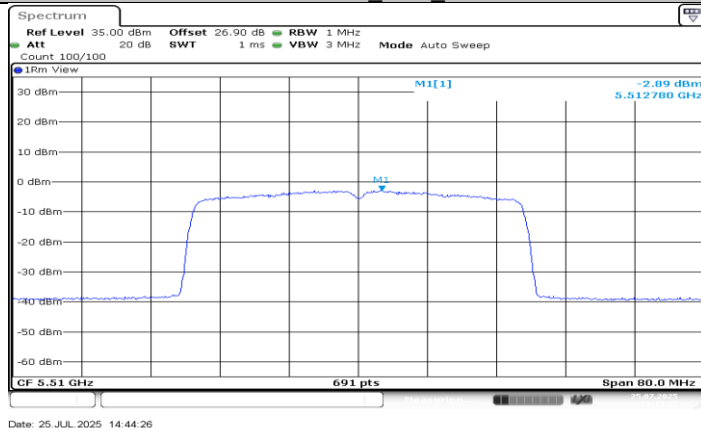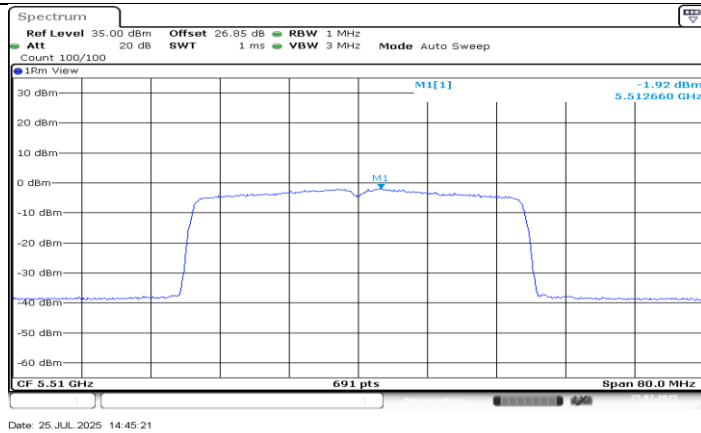

11AX40MIMO_Ant2_5270

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou)
Co., Ltd, Song Shan Lake Branch.

11AX40MIMO_Ant1_5310

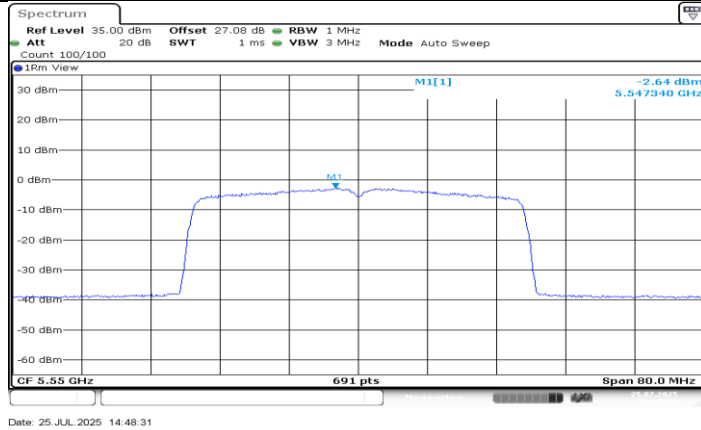

11AX40MIMO_Ant2_5310
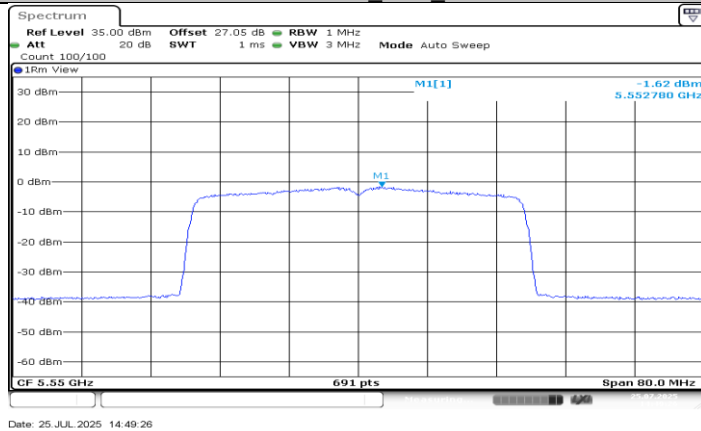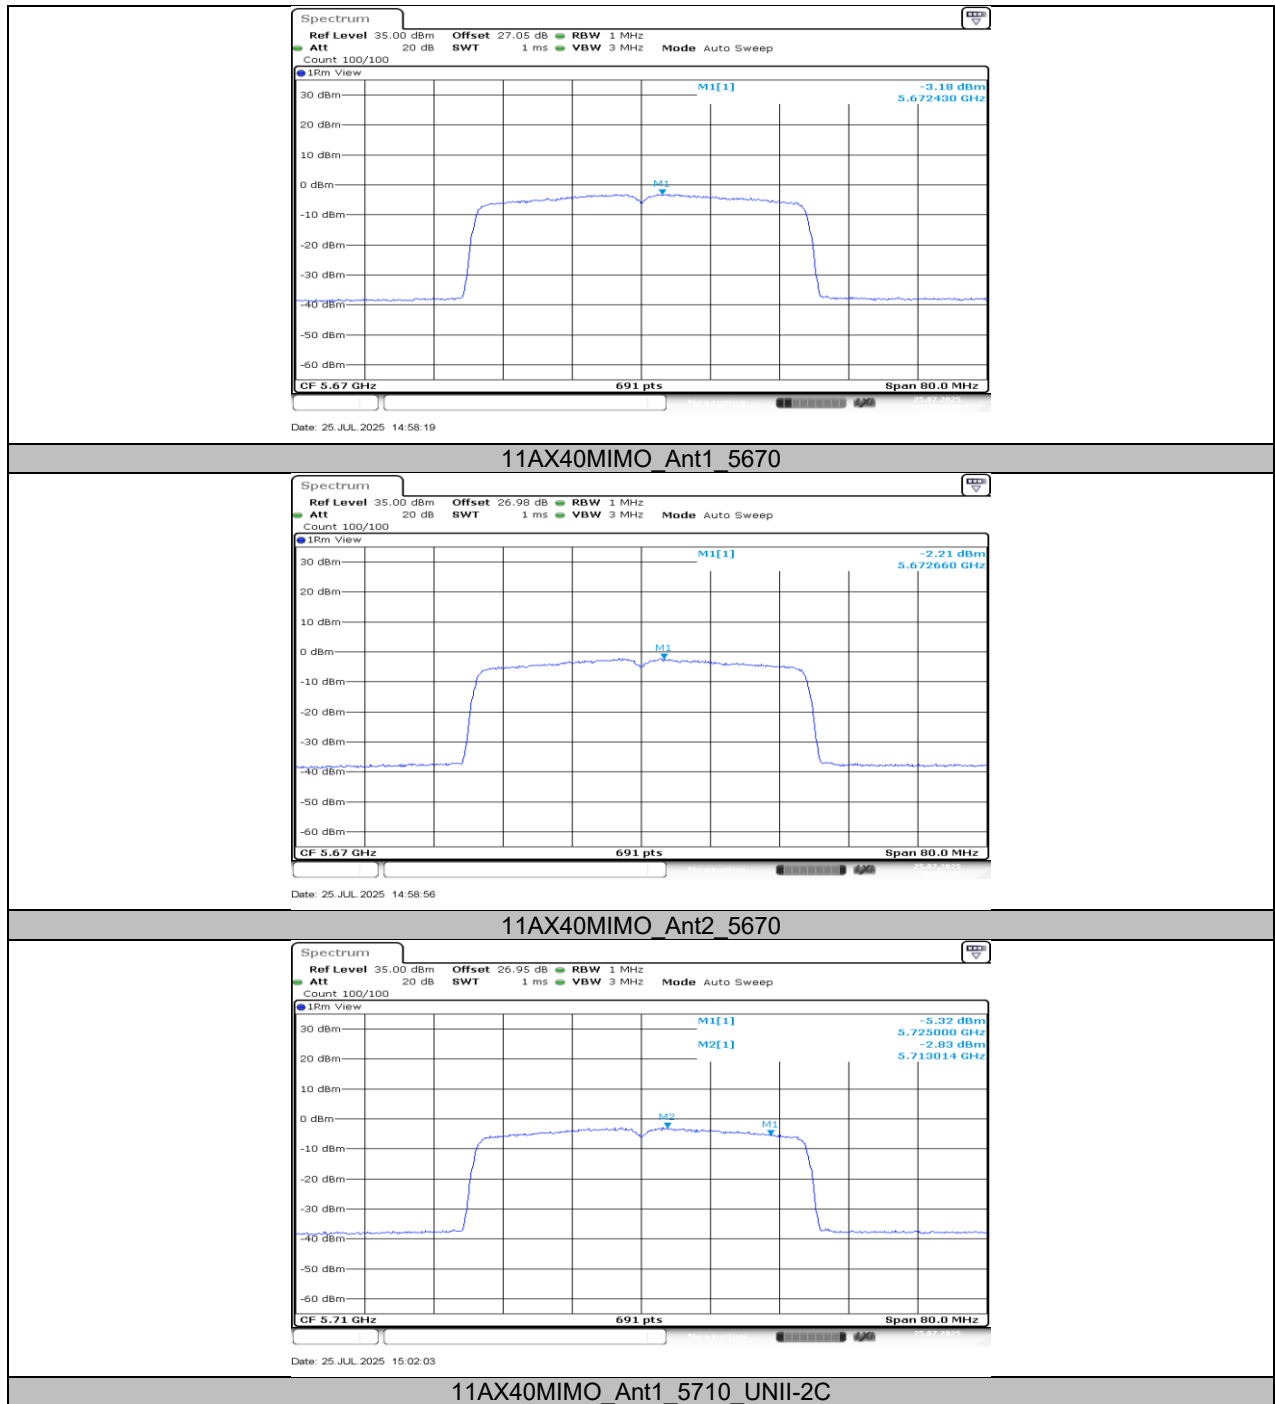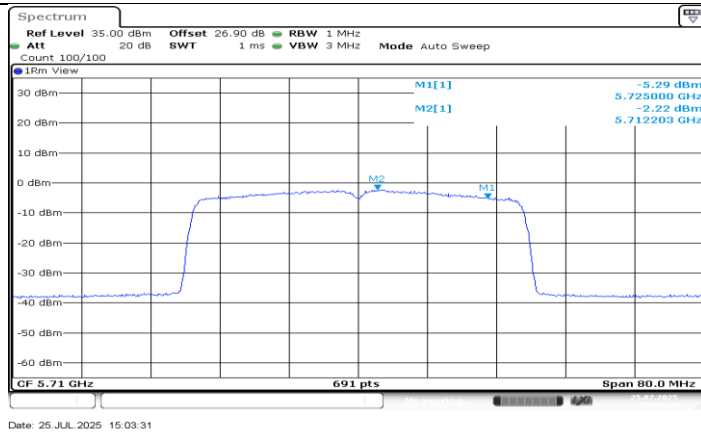

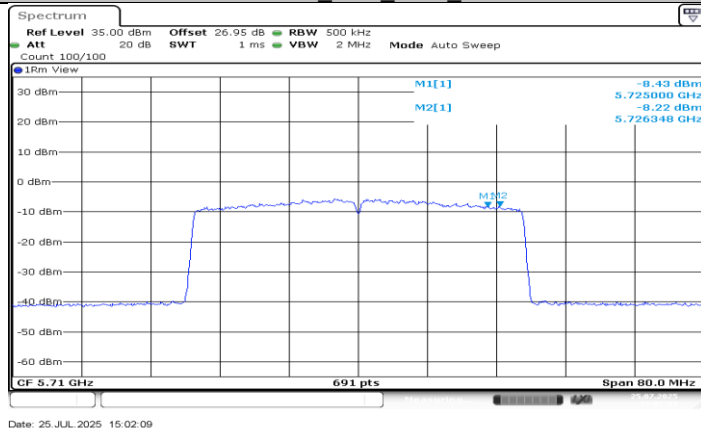11AX40MIMO_Ant1_5510

11AX40MIMO_Ant2_5510

11AX40MIMO_Ant1_5550

11AX40MIMO_Ant2_5550

11AX40MIMO_Ant1_5670

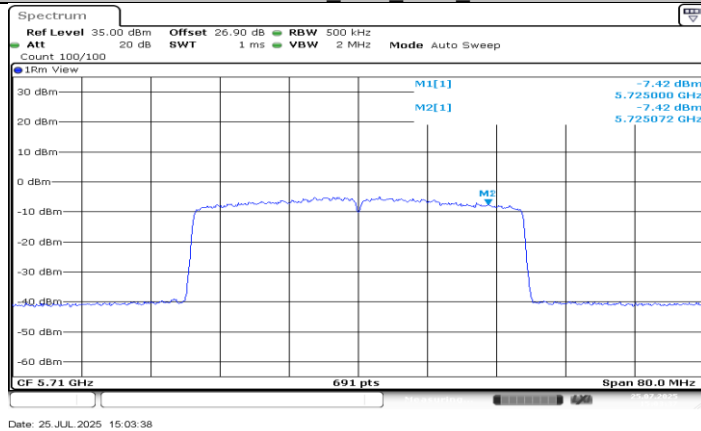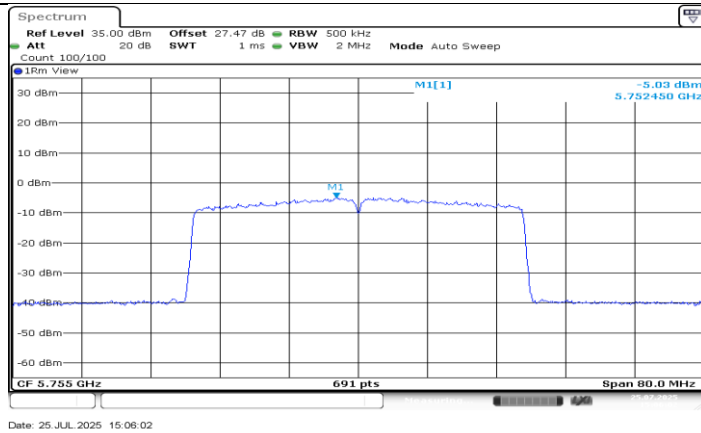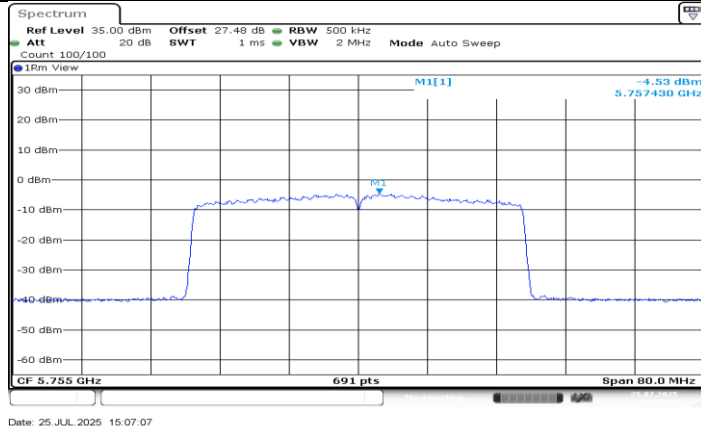

11AX40MIMO_Ant2_5670

11AX40MIMO_Ant1_5710_UNII-2C

11AX40MIMO_Ant2_5710_UNII-2C

11AX40MIMO_Ant1_5710_UNII-3

11AX40MIMO_Ant2_5710_UNII-3

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.

11AX40MIMO_Ant1_5755

11AX40MIMO_Ant2_5755

11AX40MIMO_Ant1_5795

Date: 25.JUL.2025 15:14:06

11AX40MIMO_Ant2_5795

Date: 25.JUL.2025 15:20:18

11AX80MIMO_Ant1_5210

Date: 25.JUL.2025 15:21:13

11AX80MIMO_Ant2_5210

UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch   FORM NO: 10-SL-F0035

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch.