**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| Mode: 802.11ax-HE160 | |
|---|---|
| U-NII Band I/2A | U-NII Band 2C |
| 26dB Bandwidth | 26dB Bandwidth |
| 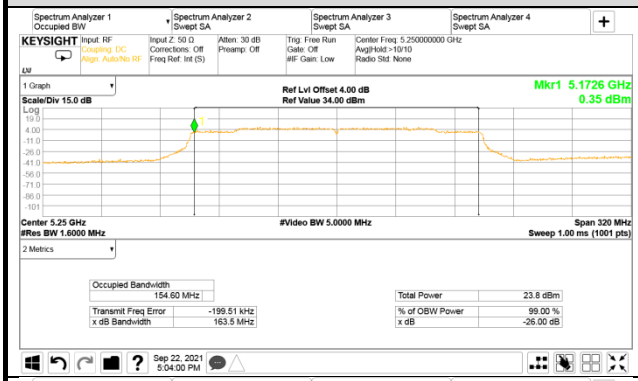 | 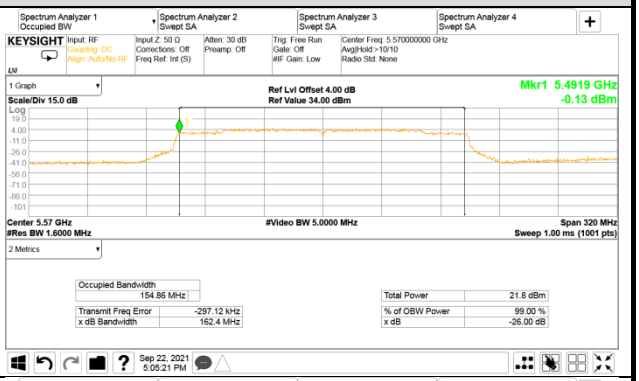 |
| 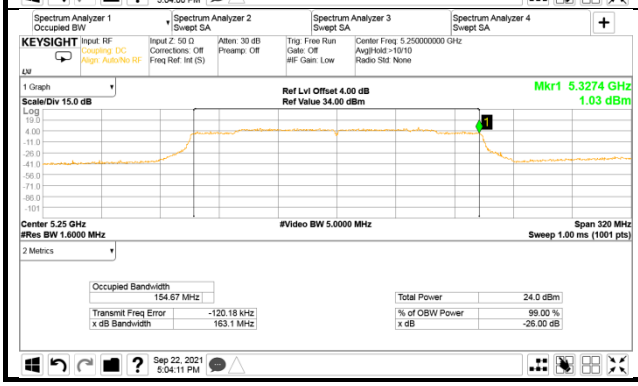 | 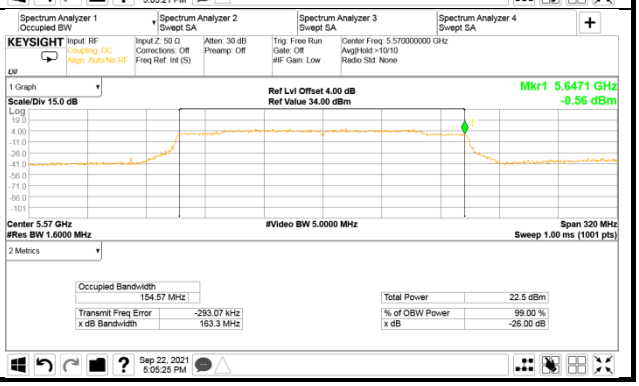 |





***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| Mode: 802.11ac-HE20 | |
|---|---|
| U-NII Band I | U-NII Band 2A |
| 26dB Bandwidth | 26dB Bandwidth |
| 5180MHz | 5320MHz |
| RU Configuration: 26/0 | RU Configuration: 26/8 |
| 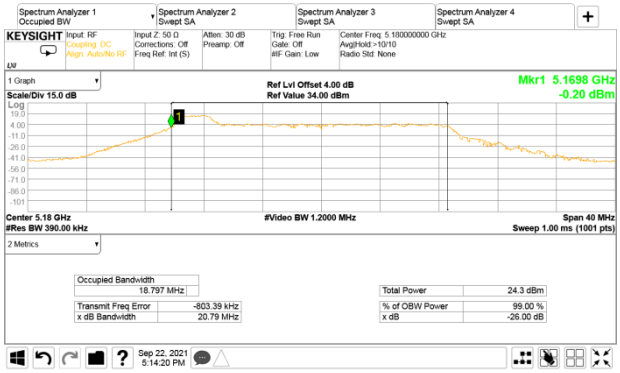 | 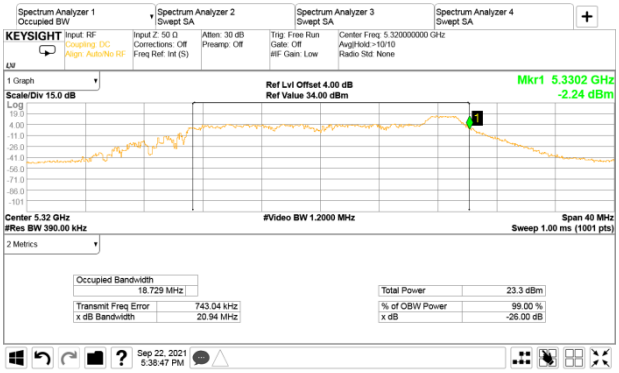 |
| RU Configuration: 52/37 | RU Configuration: 52/40 |
| 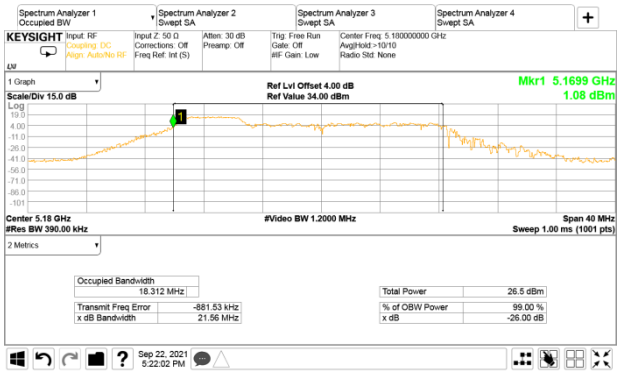 | 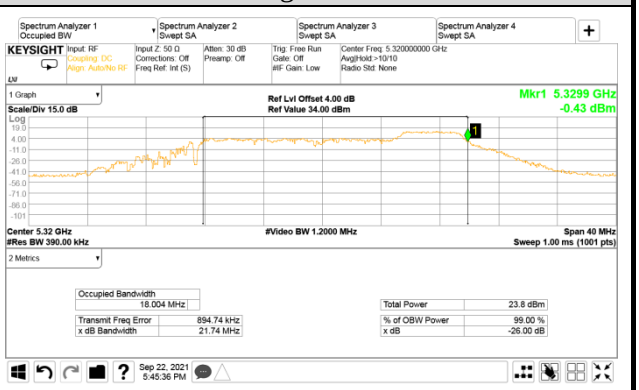 |
| RU Configuration: 106/53 | RU Configuration: 106/54 |
| 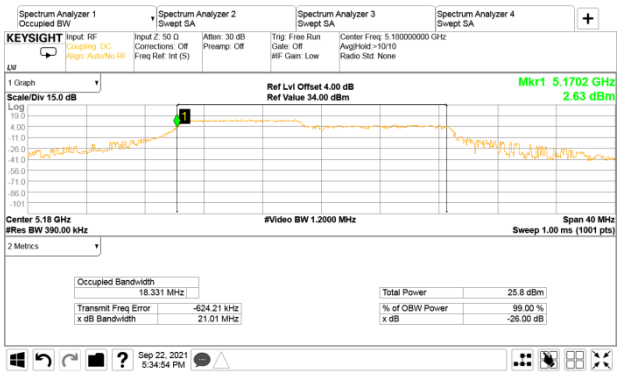 | 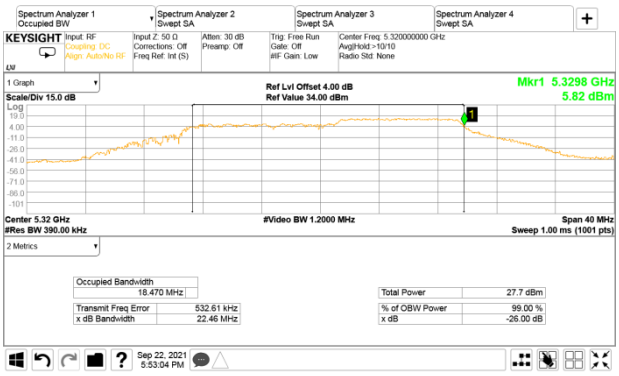 |



***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| Mode: 802.11ac-HE20 | |
|---|---|
| U-NII Band 2C | |
| 26dB Bandwidth | 26dB Bandwidth |
| 5500MHz | 5700MHz |
| RU Configuration: 26/0 | RU Configuration: 26/8 |
| 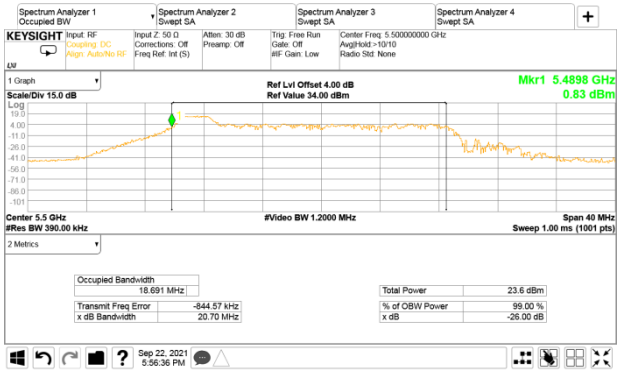 | 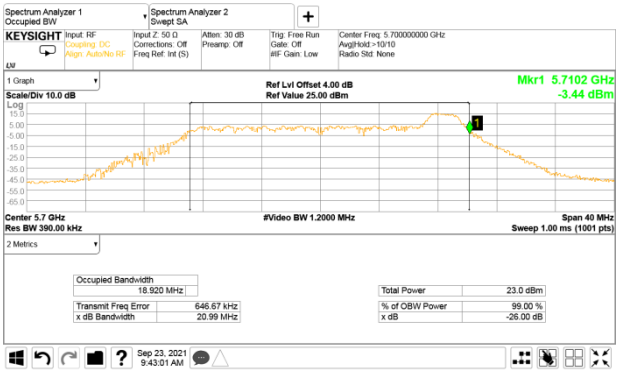 |
| RU Configuration: 52/37 | RU Configuration: 52/40 |
| 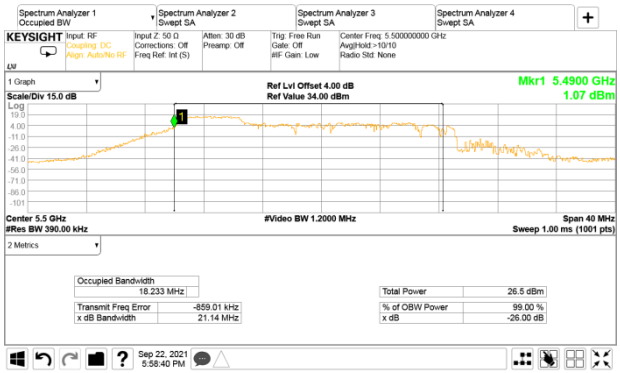 | 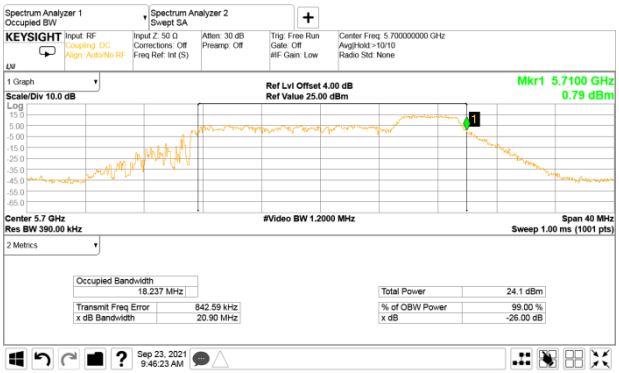 |
| RU Configuration: 106/53 | RU Configuration: 106/54 |
| 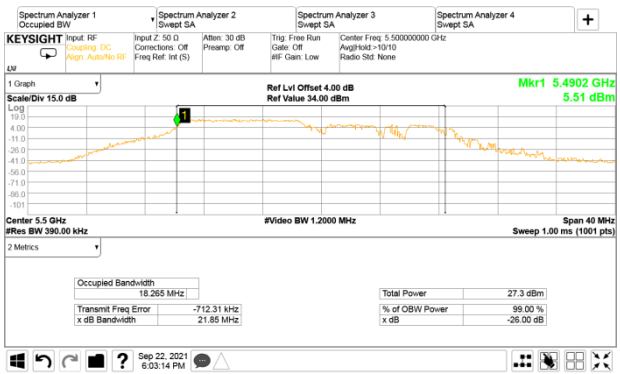 | 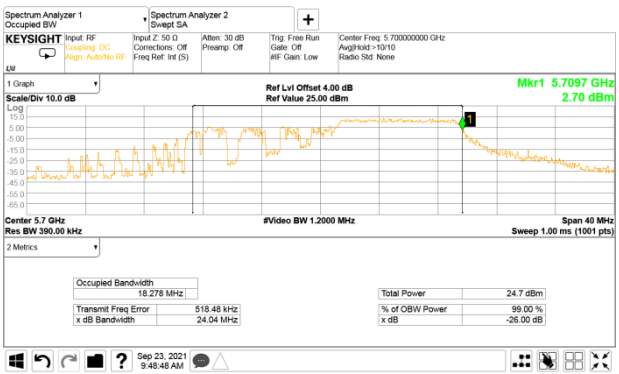 |















***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| Mode: 802.11ax-HE20 | |
|---|---|
| U-NII Band III | |
| 6dB Bandwidth | 6dB Bandwidth |
| 5745MHz | 5825MHz |
| RU Configuration: 26/0 | RU Configuration: 26/8 |
| 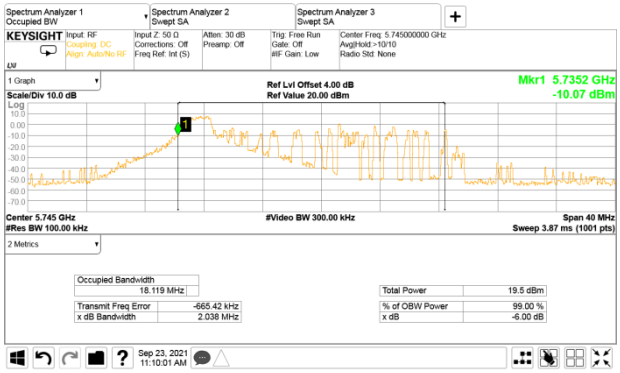 | 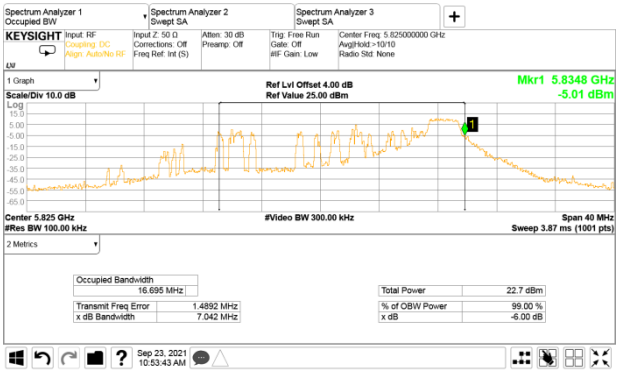 |
| RU Configuration: 52/37 | RU Configuration: 52/40 |
| 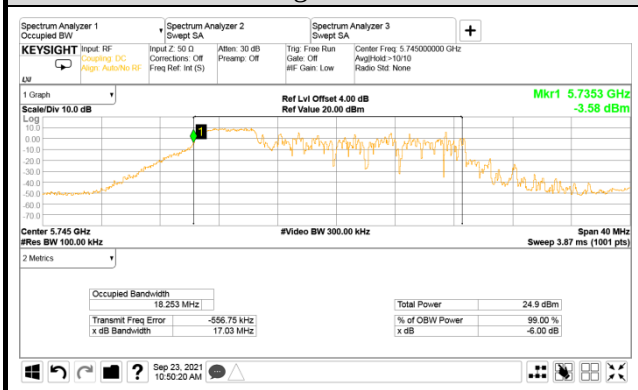 | 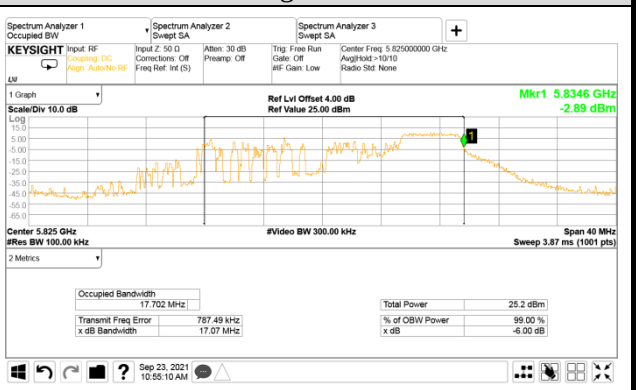 |
| RU Configuration: 106/53 | RU Configuration: 106/54 |
| 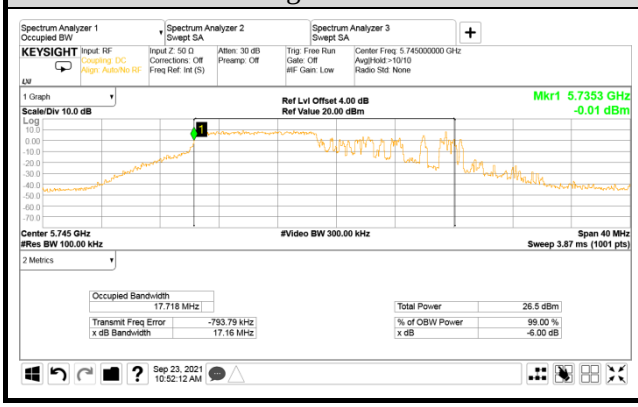 | 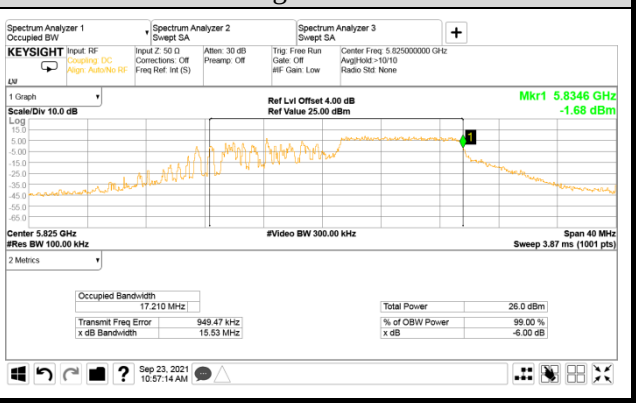 |



***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| Mode: 802.11ax-HE40 | |
|---|---|
| U-NII Band I | U-NII Band 2A |
| 26dB Bandwidth | 26dB Bandwidth |
| 5190MHz | 5310MHz |
| RU Configuration: 242/61 | RU Configuration: 242/62 |
| 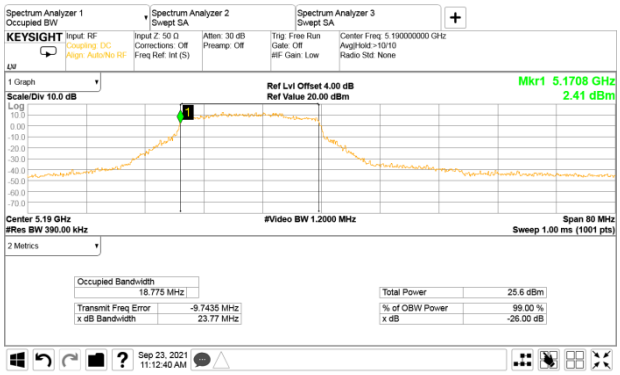 | 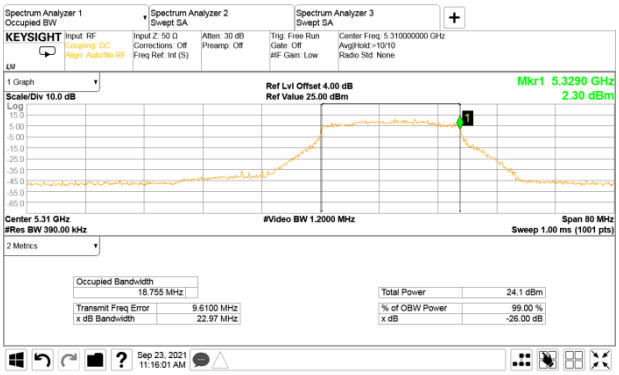 |
| U-NII Band 2C | |
| 26dB Bandwidth | 26dB Bandwidth |
| 5510MHz | 5670MHz |
| RU Configuration: 242/61 | RU Configuration: 242/62 |
| 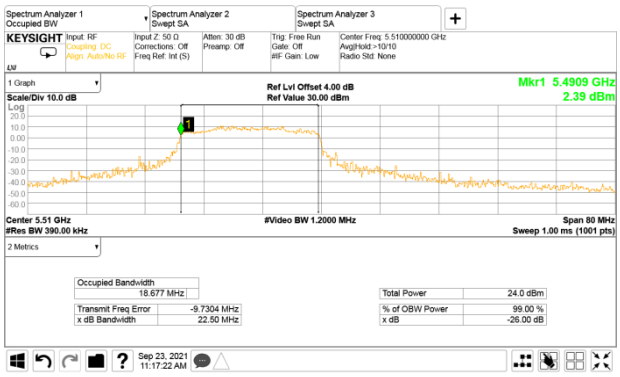 | 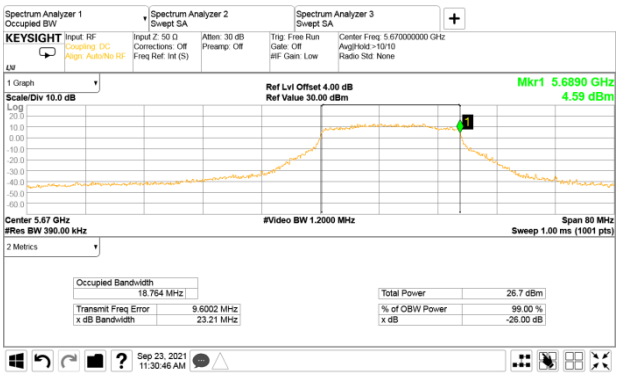 |
| U-NII Band III | |
| 6dB Bandwidth | 6dB Bandwidth |
| 5755MHz | 5795MHz |
| RU Configuration: 242/61 | RU Configuration: 242/62 |
| 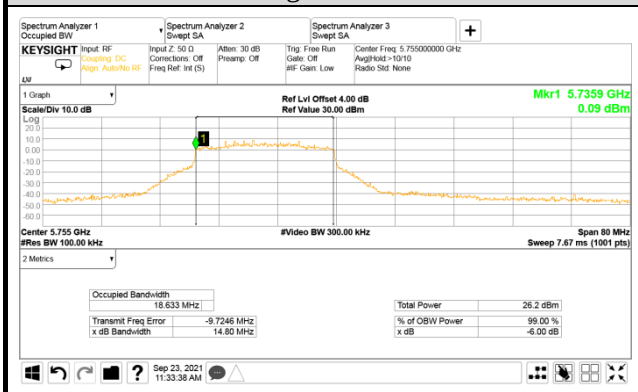 | 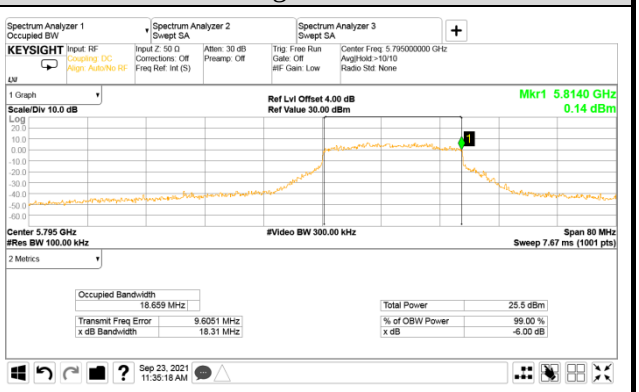 |



***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| Mode: 802.11ax-HE80 | |
|---|---|
| U-NII Band I | U-NII Band 2A |
| 26dB Bandwidth | 26dB Bandwidth |
| 5210MHz | 5290MHz |
| RU Configuration: 484/65 | RU Configuration: 484/65 |
| 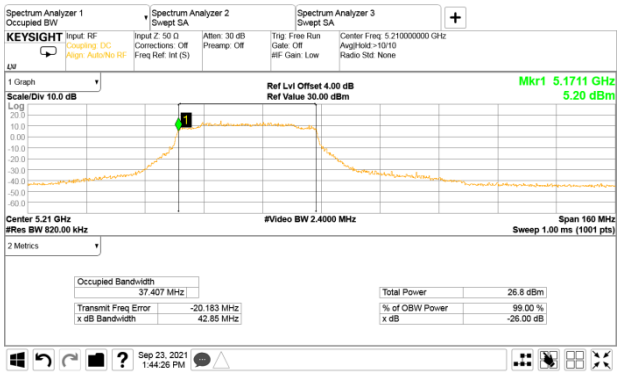 | 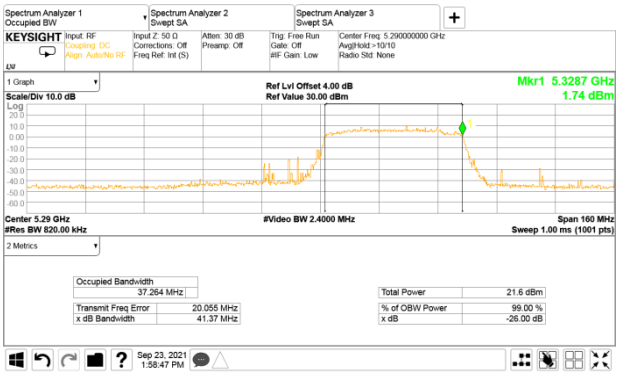 |
| U-NII Band 2C | |
| 26dB Bandwidth | 26dB Bandwidth |
| 5530MHz | 5610MHz |
| RU Configuration: 484/65 | RU Configuration: 484/66 |
| 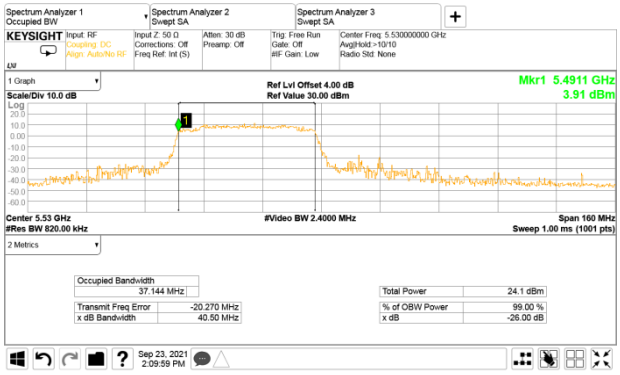 | 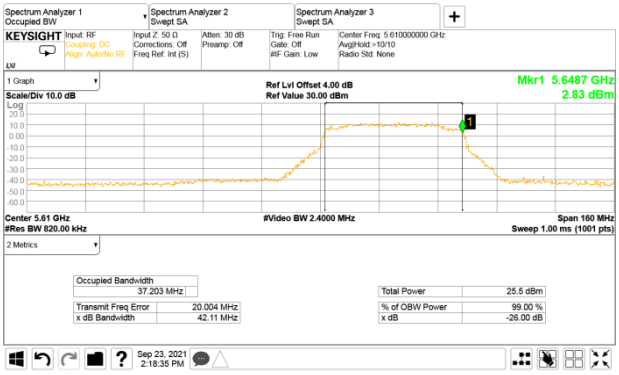 |
| U-NII Band III | |
| 6dB Bandwidth | 6dB Bandwidth |
| 5775MHz | 5775MHz |
| RU Configuration: 484/65 | RU Configuration: 484/66 |
| 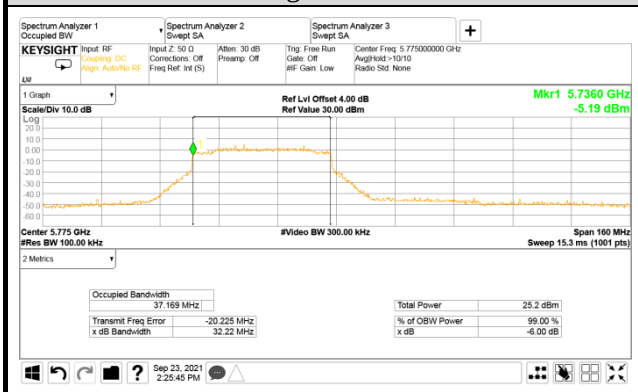 | 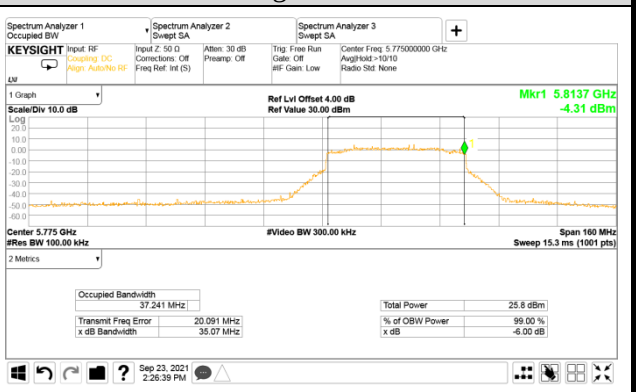 |



***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| Mode: 802.11ax-HE160 | |
|---|---|
| U-NII Band I/2A | |
| 26dB Bandwidth | 26dB Bandwidth |
| 5530MHz | |
| RU Configuration: 484/65 | RU Configuration: 484/66 |
| 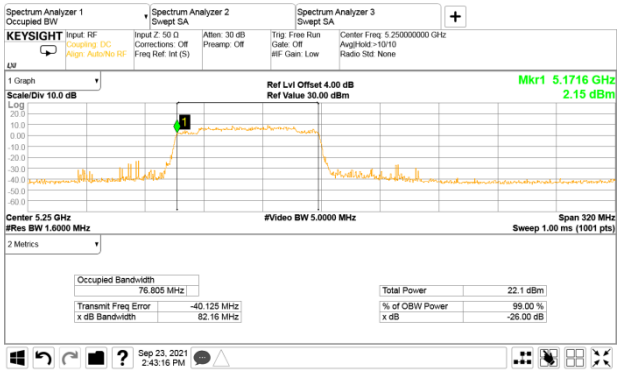 | 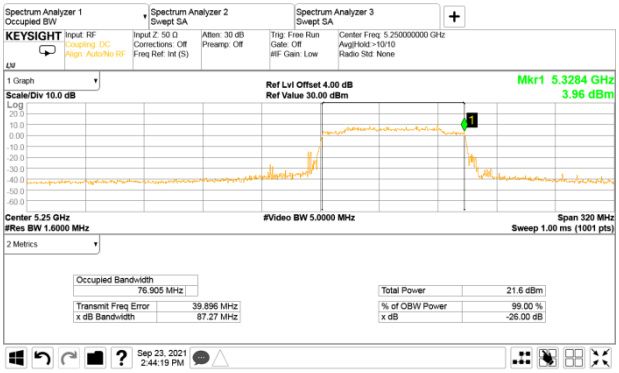 |
| U-NII Band 2C | |
| 5775MHz | |
| RU Configuration: 484/65 | RU Configuration: 484/66 |
| 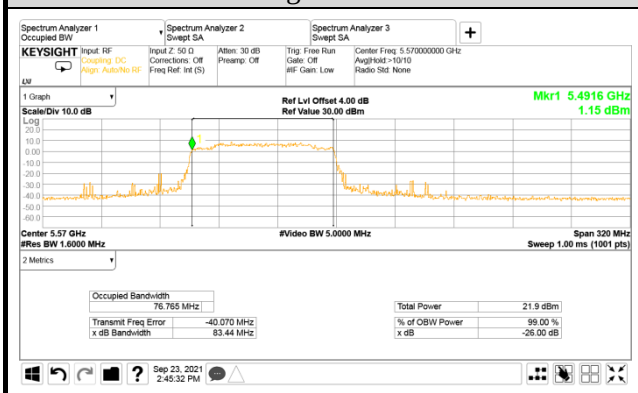 | 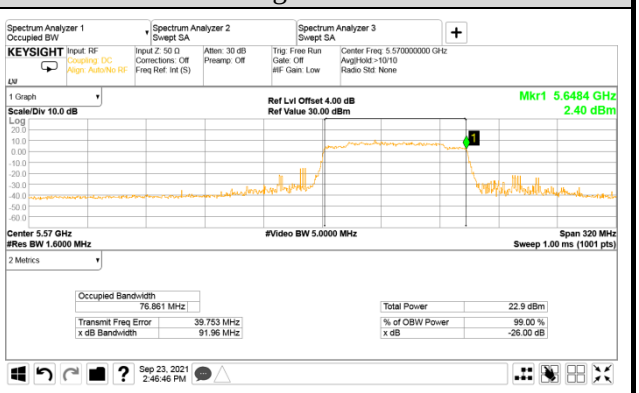 |



***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*
**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

# A.4.MAXIMUM OUTPUT POWER

| | | | |
|---|---|---|---|
| Test Date | 2021/09/08~09 | Temp./Hum. | 23~24℃/49~51% |
| Cable Loss | 1.0dB | Tested By | Kuper Hsu |
| Test Voltage | AC 120V 60Hz (Via AC Adapter) | | |

## A.4.1 Average Output Power

| Mode | U-NII Band | Centre Frequency (MHz) | Average Output Power(dBm) | | 10log (1/X) | Max Average Output Power | | Limit |
|---|---|---|---|---|---|---|---|---|
| | | | Chain 0 | Chain 1 | | (dBm) | (W) | |
| 802.11a | I | 5180 | 17.98 | 18.14 | 0 | 18.14 | 0.065 | < 250 mW (24 dBm) |
| | | 5200 | 18.91 | 18.59 | | 18.91 | 0.078 | |
| | | 5240 | 19.08 | 18.97 | | 19.08 | 0.081 | |
| | 2A | 5260 | 18.90 | 19.10 | | 19.10 | 0.081 | |
| | | 5300 | 18.90 | 18.92 | | 18.92 | 0.078 | |
| | | 5320 | 18.08 | 17.78 | | 18.08 | 0.064 | |
| | 2C | 5500 | 18.68 | 18.01 | | 18.68 | 0.074 | |
| | | 5580 | 18.47 | 18.60 | | 18.60 | 0.072 | |
| | | 5700 | 18.37 | 18.20 | | 18.37 | 0.069 | |
| | | 5720 | 17.91 | 17.55 | | 17.91 | 0.062 | |
| | III | 5745 | 18.13 | 18.15 | | 18.15 | 0.065 | < 1 W (30 dBm) |
| | | 5785 | 18.23 | 17.66 | | 18.23 | 0.067 | |
| | | 5825 | 18.11 | 17.86 | | 18.11 | 0.065 | |

Note: The results have been included cable loss.



***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*
**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| Mode | U-NII Band | Centre Frequency (MHz) | Average Output Power(dBm) | | 10log (1/X) | Total Average Output Power | | Limit |
|---|---|---|---|---|---|---|---|---|
| | | | Chain 0 | Chain 1 | | (dBm) | (W) | |
| 802.11n-HT20 | I | 5180 | 15.29 | 15.53 | 0 | 18.42 | 0.070 | < 250 mW (24 dBm) |
| | | 5200 | 15.83 | 16.16 | | 19.01 | 0.080 | |
| | | 5240 | 15.63 | 16.25 | | 18.96 | 0.079 | |
| | 2A | 5260 | 15.92 | 16.19 | | 19.07 | 0.081 | |
| | | 5300 | 15.87 | 16.20 | | 19.05 | 0.080 | |
| | | 5320 | 15.00 | 15.17 | | 18.10 | 0.065 | |
| | 2C | 5500 | 15.47 | 15.75 | | 18.62 | 0.073 | |
| | | 5580 | 16.97 | 17.35 | | 20.17 | 0.104 | |
| | | 5700 | 14.31 | 14.70 | | 17.52 | 0.056 | |
| | | 5720 | 17.15 | 17.34 | | 20.26 | 0.106 | |
| | III | 5745 | 17.24 | 17.01 | | 20.14 | 0.103 | < 1 W (30 dBm) |
| | | 5785 | 16.96 | 17.30 | | 20.14 | 0.103 | |
| | | 5825 | 17.15 | 16.87 | | 20.02 | 0.100 | |
| 802.11n-HT40 | I | 5190 | 15.47 | 15.68 | 0 | 18.59 | 0.072 | < 250 mW (24 dBm) |
| | | 5230 | 16.05 | 15.87 | | 18.97 | 0.079 | |
| | 2A | 5270 | 15.90 | 15.98 | | 18.95 | 0.079 | |
| | | 5310 | 14.55 | 14.79 | | 17.68 | 0.059 | |
| | 2C | 5510 | 15.00 | 14.97 | | 18.00 | 0.063 | |
| | | 5550 | 15.65 | 15.30 | | 18.49 | 0.071 | |
| | | 5670 | 17.05 | 16.81 | | 19.94 | 0.099 | |
| | | 5710 | 17.65 | 17.82 | | 20.75 | 0.119 | |
| | III | 5755 | 17.34 | 17.77 | | 20.57 | 0.114 | < 1 W (30 dBm) |
| | | 5795 | 17.52 | 17.48 | | 20.51 | 0.112 | |
| 802.11ac-VHT80 | I | 5210 | 15.82 | 15.62 | 0 | 18.73 | 0.075 | < 250 mW (24 dBm) |
| | 2A | 5290 | 14.66 | 14.53 | | 17.61 | 0.058 | |
| | 2C | 5530 | 15.42 | 15.23 | | 18.34 | 0.068 | |
| | | 5610 | 17.72 | 17.51 | | 20.63 | 0.116 | |
| | | 5690 | 18.03 | 17.84 | | 20.95 | 0.124 | |
| | III | 5775 | 16.45 | 16.26 | | 19.37 | 0.086 | < 1 W (30 dBm) |
| 802.11ac-VHT160 | I/ 2A | 5250 | 11.34 | 11.53 | 0 | 14.45 | 0.028 | < 250 mW (24 dBm) |
| | 2C | 5570 | 10.91 | 10.94 | | 13.94 | 0.025 | |

Note: The results have been included cable loss.



***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*
**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| Mode | U-NII Band | Centre Frequency (MHz) | Average Output Power(dBm) | | 10log (1/X) | Total Average Output Power | | Limit |
|---|---|---|---|---|---|---|---|---|
| | | | Chain 0 | Chain 1 | | (dBm) | (W) | |
| 802.11ax-HE20 | I | 5180 | 15.42 | 15.04 | 0 | 18.24 | 0.067 | < 250 mW (24 dBm) |
| | | 5200 | 15.84 | 15.90 | | 18.88 | 0.077 | |
| | | 5240 | 16.00 | 15.81 | | 18.92 | 0.078 | |
| | 2A | 5260 | 16.07 | 15.89 | | 18.99 | 0.079 | |
| | | 5300 | 16.03 | 15.95 | | 19.00 | 0.079 | |
| | | 5320 | 15.24 | 14.91 | | 18.09 | 0.064 | |
| | 2C | 5500 | 15.59 | 15.45 | | 18.53 | 0.071 | |
| | | 5580 | 17.04 | 16.69 | | 19.88 | 0.097 | |
| | | 5700 | 14.76 | 14.57 | | 17.68 | 0.059 | |
| | | 5720 | 17.15 | 16.88 | | 20.03 | 0.101 | |
| | III | 5745 | 16.91 | 17.18 | | 20.06 | 0.101 | < 1 W (30 dBm) |
| | | 5785 | 17.10 | 17.05 | | 20.09 | 0.102 | |
| | | 5825 | 16.97 | 17.30 | | 20.15 | 0.104 | |
| 802.11ax-HE40 | I | 5190 | 15.10 | 14.89 | 0 | 18.01 | 0.063 | < 250 mW (24 dBm) |
| | | 5230 | 16.79 | 16.50 | | 19.66 | 0.092 | |
| | 2A | 5270 | 16.20 | 16.09 | | 19.16 | 0.082 | |
| | | 5310 | 14.04 | 14.15 | | 17.11 | 0.051 | |
| | 2C | 5510 | 14.59 | 14.24 | | 17.43 | 0.055 | |
| | | 5550 | 15.43 | 15.33 | | 18.39 | 0.069 | |
| | | 5670 | 16.66 | 16.40 | | 19.54 | 0.090 | |
| | | 5710 | 17.29 | 16.84 | | 20.08 | 0.102 | |
| | III | 5755 | 17.05 | 17.22 | | 20.15 | 0.104 | < 1 W (30 dBm) |
| | | 5795 | 17.21 | 17.15 | | 20.19 | 0.104 | |
| 802.11ax-HE80 | I | 5210 | 15.55 | 15.37 | 0 | 18.47 | 0.070 | < 250 mW (24 dBm) |
| | 2A | 5290 | 14.32 | 14.38 | | 17.36 | 0.054 | |
| | 2C | 5530 | 14.88 | 15.13 | | 18.02 | 0.063 | |
| | | 5610 | 17.42 | 17.09 | | 20.27 | 0.106 | |
| | | 5690 | 17.44 | 17.15 | | 20.31 | 0.107 | |
| | III | 5775 | 16.09 | 16.12 | | 19.12 | 0.082 | < 1 W (30 dBm) |
| 802.11ax-HE160 | I/ 2A | 5250 | 11.47 | 11.78 | 0 | 14.64 | 0.029 | < 250 mW (24 dBm) |
| | 2C | 5570 | 11.12 | 11.44 | | 14.29 | 0.027 | |

Note: The results have been included cable loss.



***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*
**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| Mode | U-NII Band | Centre Frequency (MHz) | RU Configuration | Average Output Power(dBm) | | 10log (1/X) | Total Average Output Power | | Limit |
|---|---|---|---|---|---|---|---|---|---|
| | | | | Chain 0 | Chain 1 | | (dBm) | (W) | |
| 802.11ax-HE20 | I | 5180 | 26/0 | 11.35 | 11.00 | 0 | 14.19 | 0.026 | < 250 mW (24 dBm) |
| | | | 52/37 | 14.16 | 14.00 | | 17.09 | 0.051 | |
| | | | 106/53 | 15.43 | 15.20 | | 18.33 | 0.068 | |
| | 2A | 5320 | 26/8 | 11.61 | 11.45 | | 14.54 | 0.028 | |
| | | | 52/40 | 11.67 | 11.29 | | 14.49 | 0.028 | |
| | | | 106/54 | 15.29 | 15.49 | | 18.40 | 0.069 | |
| | 2C | 5500 | 26/0 | 11.37 | 11.09 | | 14.24 | 0.027 | |
| | | | 52/37 | 14.68 | 14.22 | | 17.47 | 0.056 | |
| | | | 106/53 | 15.43 | 15.68 | | 18.57 | 0.072 | |
| | | 5700 | 26/8 | 11.58 | 11.36 | | 14.48 | 0.028 | |
| | | | 52/40 | 12.77 | 12.46 | | 15.63 | 0.037 | |
| | | | 106/54 | 14.36 | 14.09 | | 17.24 | 0.053 | |
| | III | 5745 | 26/0 | 11.51 | 11.10 | | 14.32 | 0.027 | < 1 W (30 dBm) |
| | | | 52/37 | 14.39 | 14.00 | | 17.21 | 0.053 | |
| | | | 106/53 | 16.97 | 16.70 | | 19.85 | 0.097 | |
| | | 5825 | 26/8 | 14.98 | 14.65 | | 17.83 | 0.061 | |
| | | | 52/40 | 16.18 | 16.95 | | 19.59 | 0.091 | |
| | | | 106/54 | 16.55 | 16.60 | | 19.59 | 0.091 | |
| 802.11ax-HE40 | I | 5190 | 242/61 | 15.41 | 14.99 | 0 | 18.22 | 0.066 | < 250 mW (24 dBm) |
| | 2A | 5310 | 242/62 | 13.97 | 14.41 | | 17.21 | 0.053 | |
| | 2C | 5510 | 242/61 | 14.78 | 14.32 | | 17.57 | 0.057 | |
| | | 5670 | 242/62 | 16.42 | 16.39 | | 19.42 | 0.087 | |
| | III | 5755 | 242/61 | 16.92 | 16.63 | | 19.79 | 0.095 | < 1 W (30 dBm) |
| | | 5795 | 242/62 | 16.53 | 16.38 | | 19.47 | 0.089 | |
| 802.11ax-HE80 | I | 5210 | 484/65 | 15.24 | 14.84 | 0 | 18.05 | 0.064 | < 250 mW (24 dBm) |
| | 2A | 5290 | 484/66 | 11.41 | 11.88 | | 14.66 | 0.029 | |
| | 2C | 5530 | 484/65 | 13.47 | 13.47 | | 16.48 | 0.044 | |
| | | 5610 | 484/66 | 15.67 | 15.57 | | 18.63 | 0.073 | |
| | III | 5775 | 484/65 | 15.66 | 15.42 | | 18.55 | 0.072 | < 1 W (30 dBm) |
| | | | 484/66 | 15.46 | 15.17 | | 18.33 | 0.068 | |
| 802.11ax-HE160 | I/ 2A | 5250 | 996/67 | 10.37 | 10.23 | 0 | 13.31 | 0.021 | < 250 mW (24 dBm) |
| | | | 996/S67 | 10.11 | 10.08 | | 13.11 | 0.020 | |
| | 2C | 5570 | 996/67 | 9.72 | 9.49 | | 12.62 | 0.018 | |
| | | | 996/S67 | 10.19 | 10.02 | | 13.12 | 0.021 | |

Note: The results have been included cable loss.



***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

## A.4.2 Measurement Plots

| 802.11ac-VHT80 | |
|---|---|
| U-NII Band I | |
| Chain 0 | Chain 1 |
| 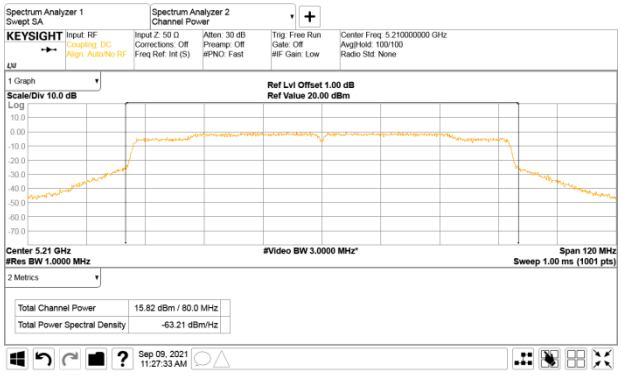 | 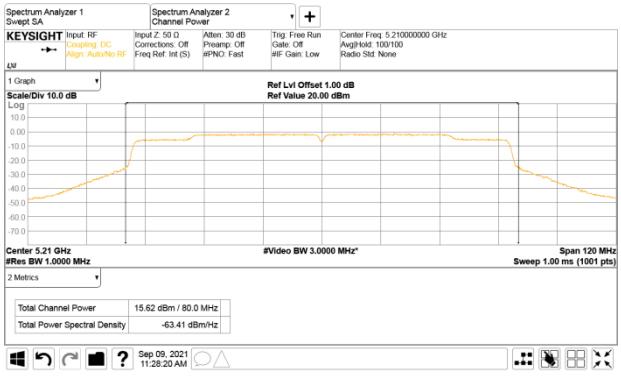 |
| U-NII Band 2A | |
| Chain 0 | Chain 1 |
| 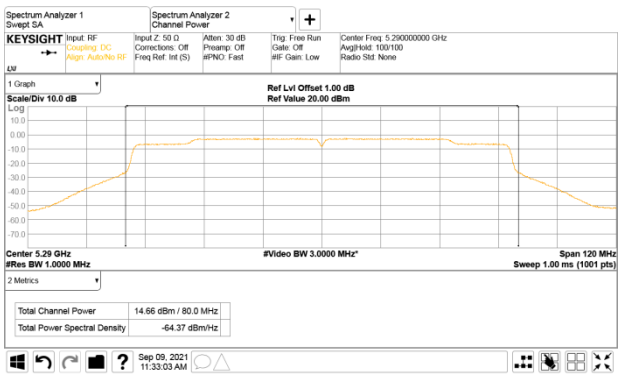 | 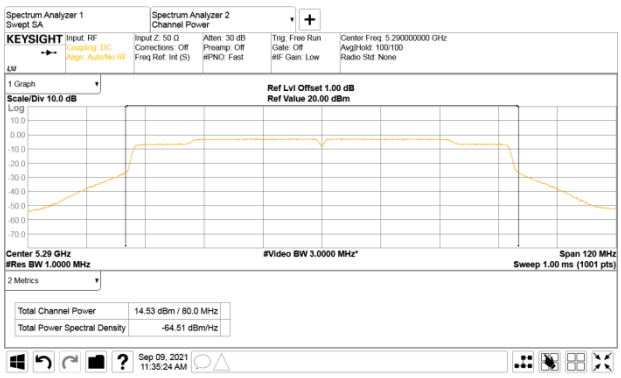 |



***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| 802.11ac-VHT80 | |
|---|---|
| U-NII Band 2C | |
| Chain 0 | Chain 1 |
| 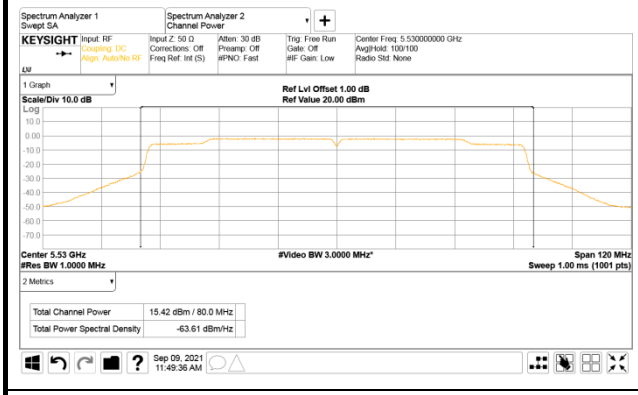 | 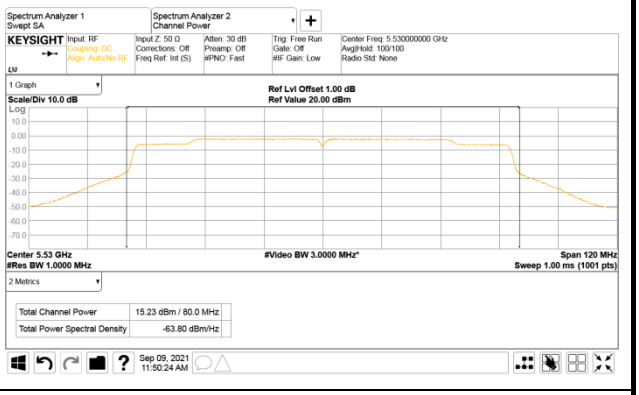 |
| 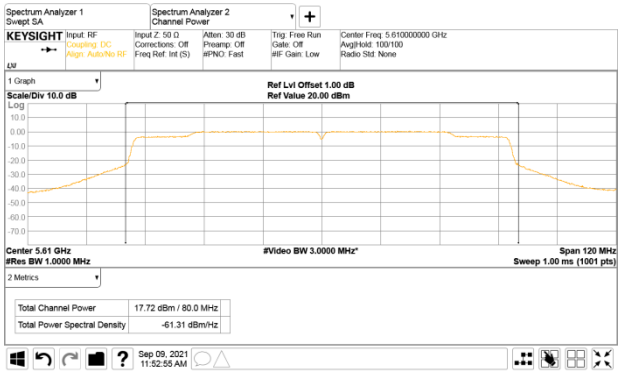 | 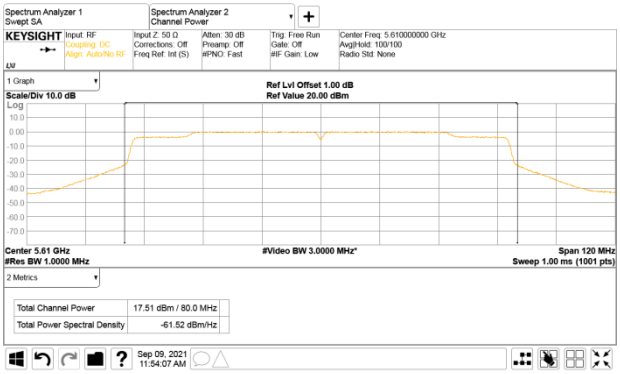 |
| 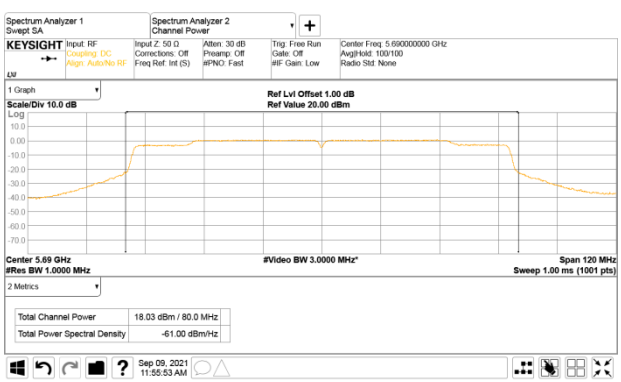 | 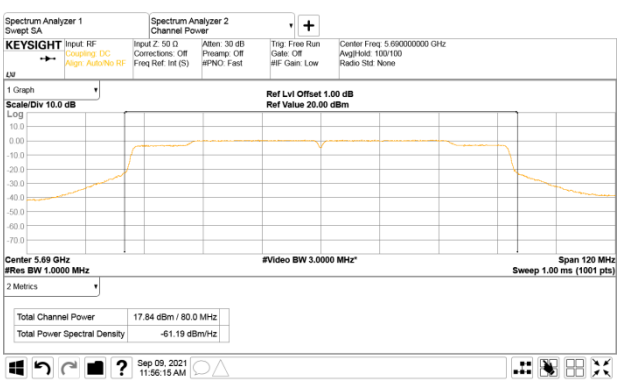 |





***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| 802.11ac-VHT80 | |
|---|---|
| U-NII Band III | |
| Chain 0 | Chain 1 |
| 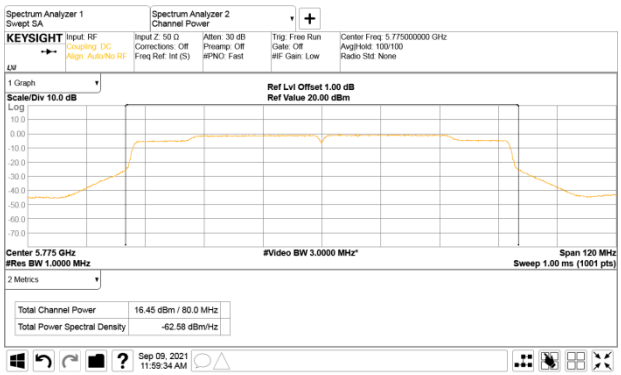 | 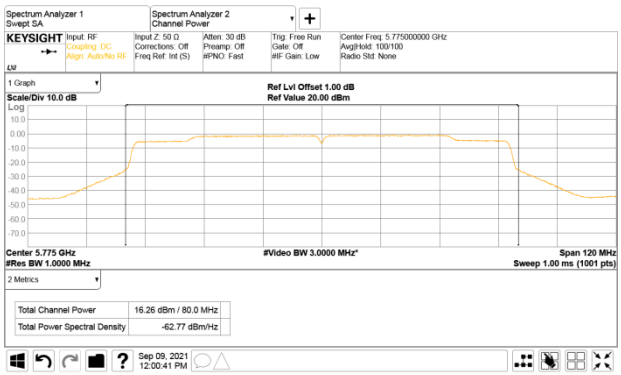 |





***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

## 802.11ac-VHT160

### U-NII Band I/2A

#### Chain 0




#### Chain 1




### U-NII Band 2C

#### Chain 0

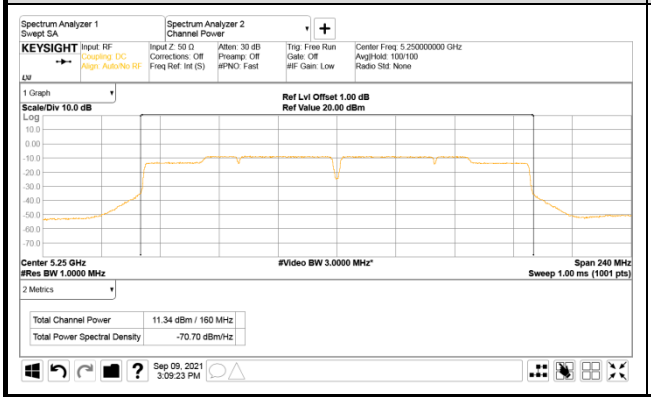


#### Chain 1

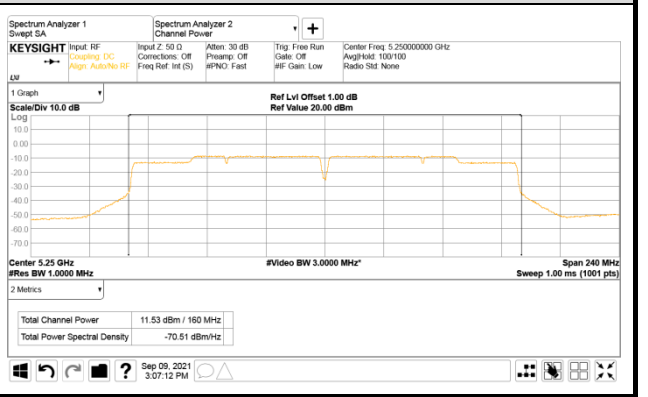




***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

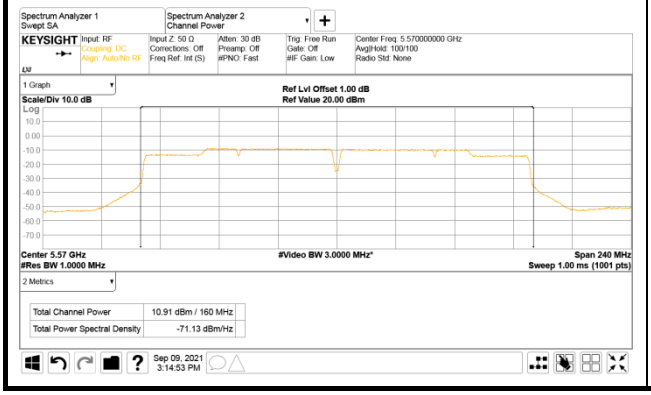**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**
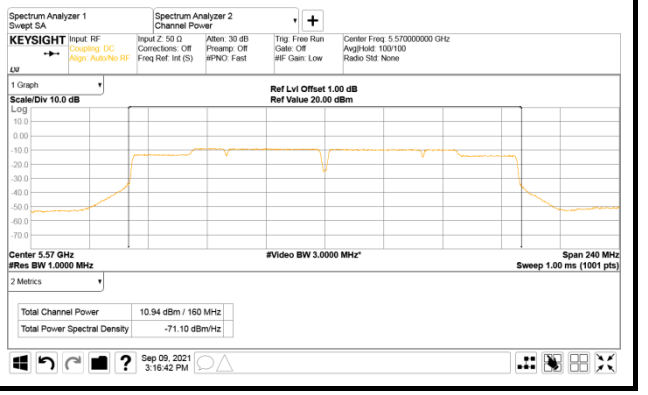
| 802.11ax-HE80 | |
|---|---|
| U-NII Band I | |
| Chain 0 | Chain 1 |
| 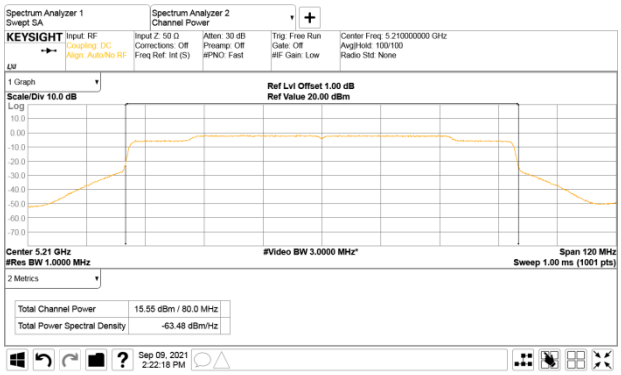 | 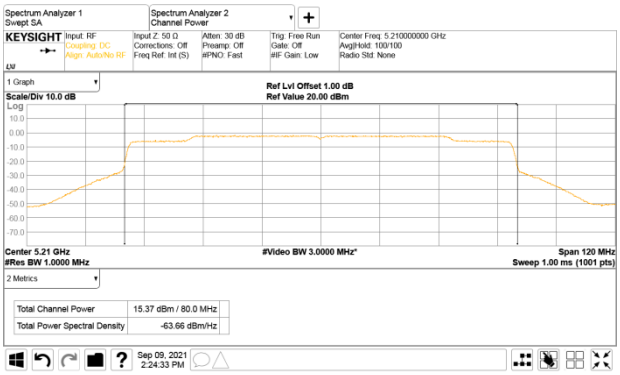 |
| U-NII Band 2A | |
| Chain 0 | Chain 1 |
| 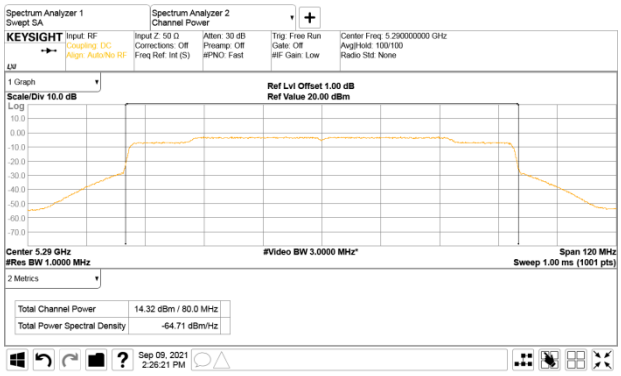 | 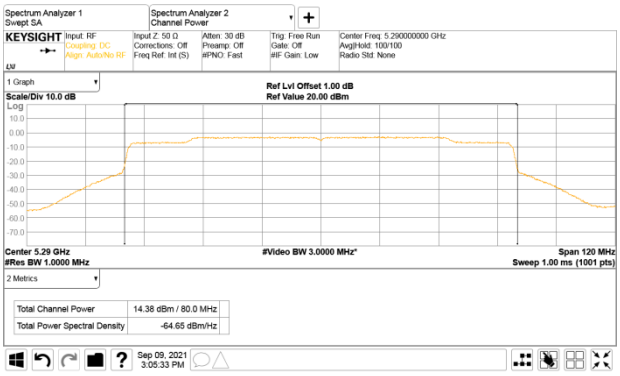 |











***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| 802.11ax-HE 80 | |
|---|---|
| U-NII Band 2C | |
| Chain 0 | Chain 1 |
| 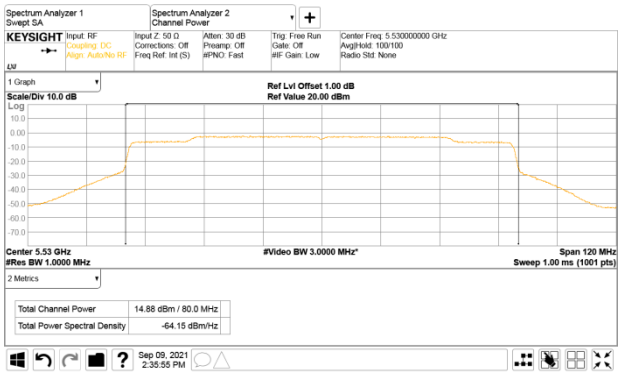 | 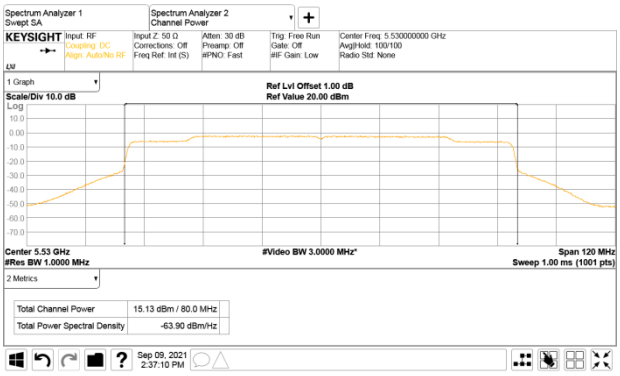 |
| 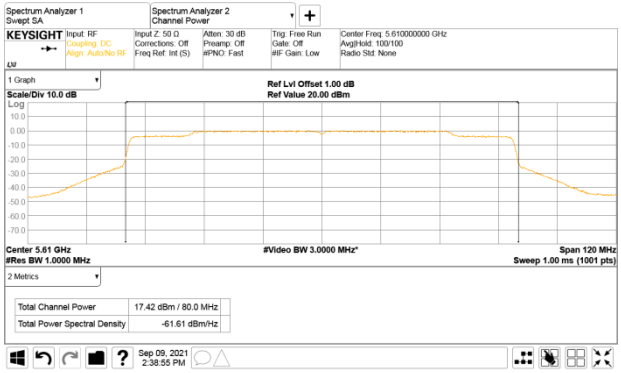 | 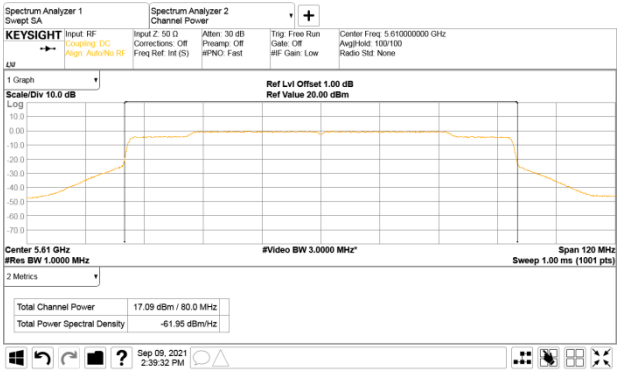 |
| 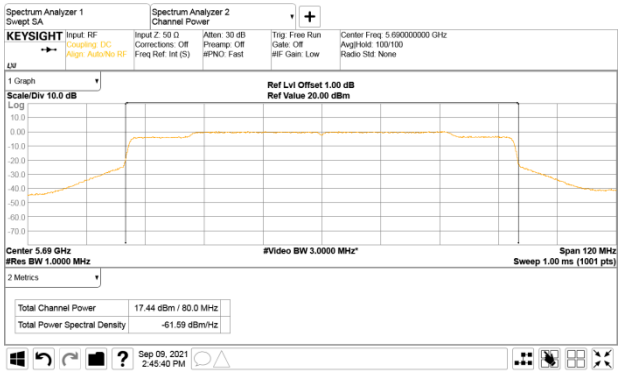 | 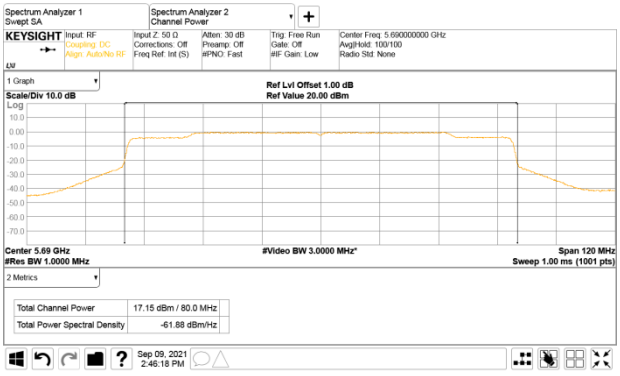 |





***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| 802.11ax-HE 80 | |
|---|---|
| U-NII Band III | |
| Chain 0 | Chain 1 |
| 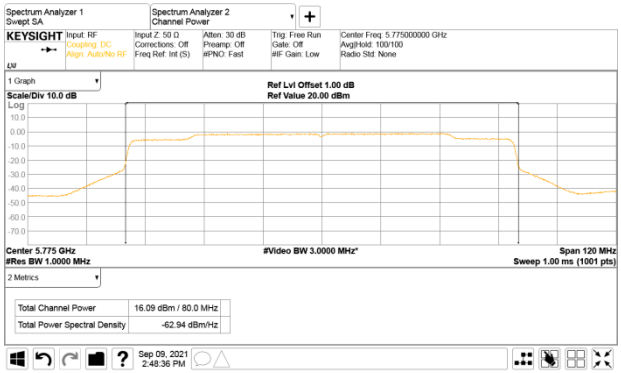 | 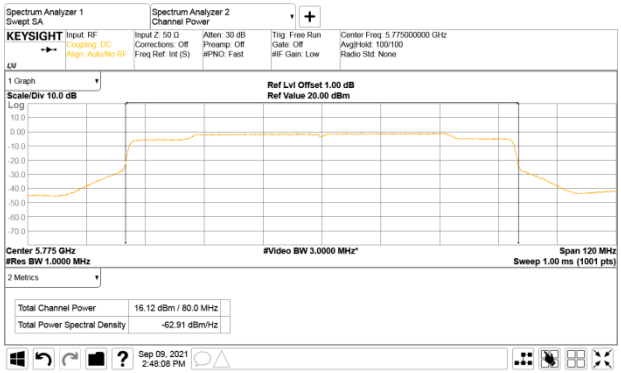 |







***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| 802.11ax-HE160 | |
|---|---|
| U-NII Band I/2A | |
| Chain 0 | Chain 1 |
| 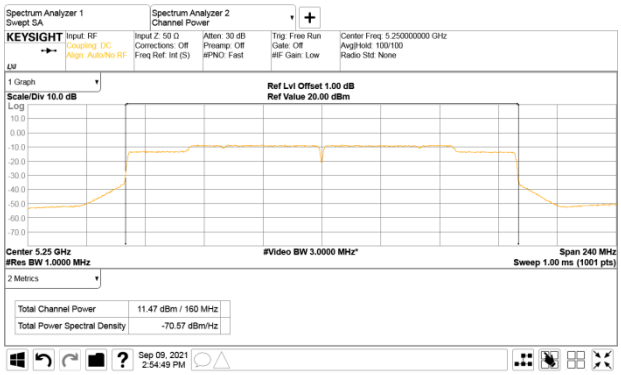 | 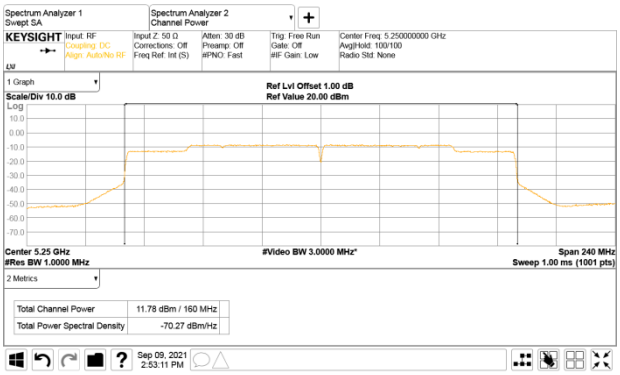 |
| U-NII Band 2C | |
| Chain 0 | Chain 1 |
| 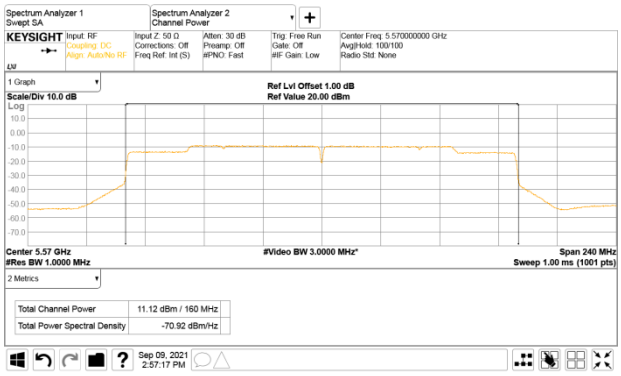 | 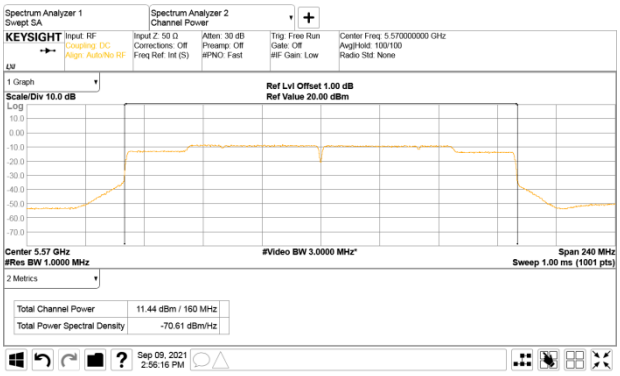 |











***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| 802.11ax-HE160 | |
|---|---|
| U-NII Band I/2A | |
| 5250MHz | |
| RU Configuration: 996/67 | |
| Chain 0 | Chain 1 |
| 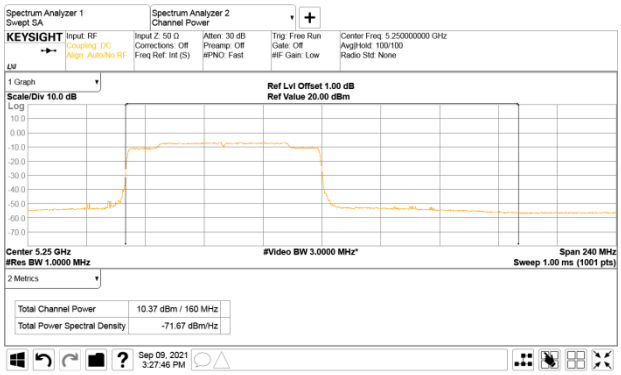 | 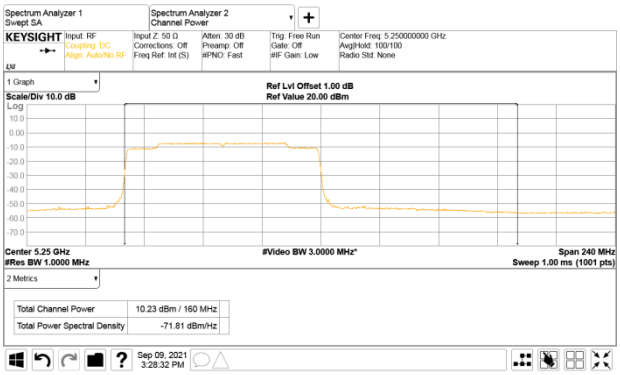 |
| RU Configuration: 996/S67 | |
| Chain 0 | Chain 1 |
| 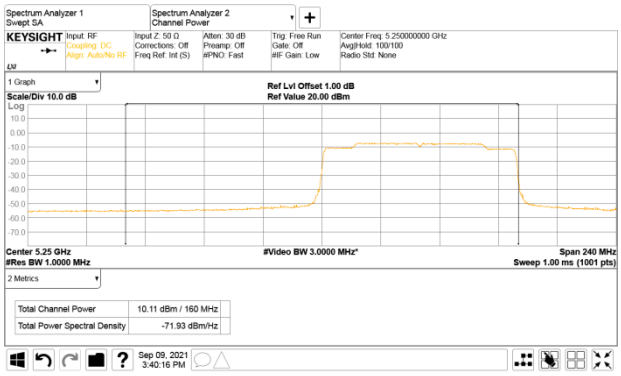 | 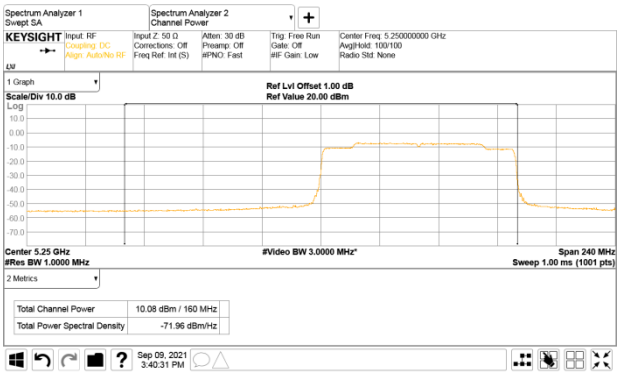 |











***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***

**Audix Technology Corp.**
*No. 491, Zhongfu Rd., Linkou Dist.,*
*New Taipei City244, Taiwan*

**Tel: +886 2 26099301**
**Fax: +886 2 26099303**

| 802.11ax-HE160 | |
|---|---|
| U-NII Band III | |
| 5570MHz | |
| RU Configuration: 996/67 | |
| Chain 0 | Chain 1 |
| 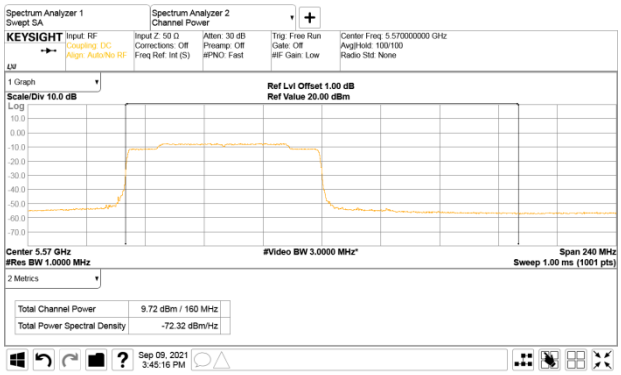 | 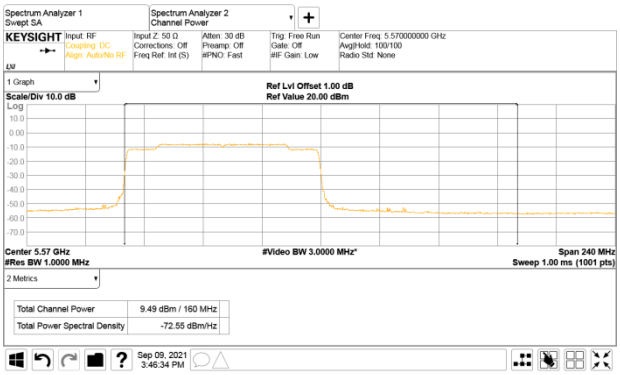 |
| RU Configuration: 996/S67 | |
| Chain 0 | Chain 1 |
| 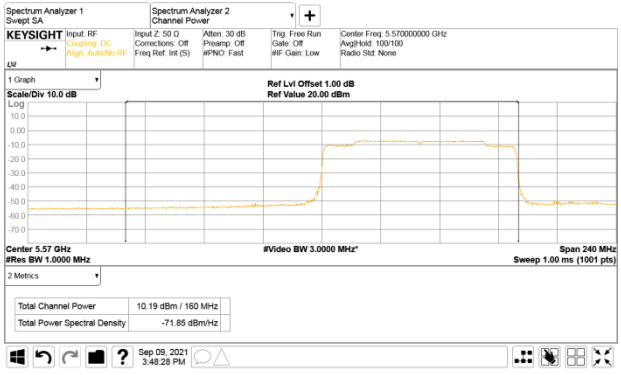 | 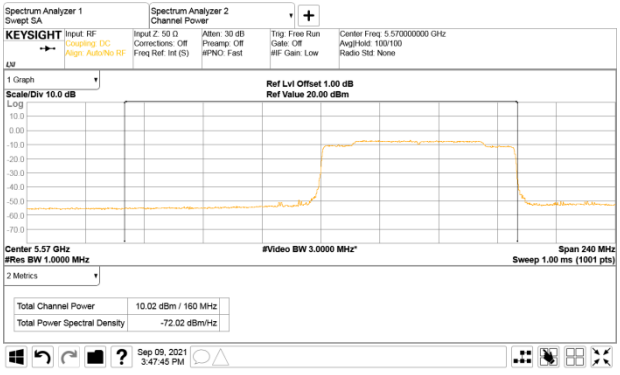 |





***This test report may be reproduced in full only. The document may only be updated by Audix Technology Corp. personnel. Any changes will be noted in the Document History section of the report.***