n38 40M DFT-s-OFDM BPSK Outer_Full Low



n38 40M DFT-s-OFDM QPSK Outer_Full Low



n38 40M DFT-s-OFDM 16QAM Outer_Full Low



n38 40M DFT-s-OFDM 64QAM Outer_Full Low



n38 40M DFT-s-OFDM 256QAM Outer_Full Low



n38 40M CP-OFDM QPSK Outer_Full Low

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

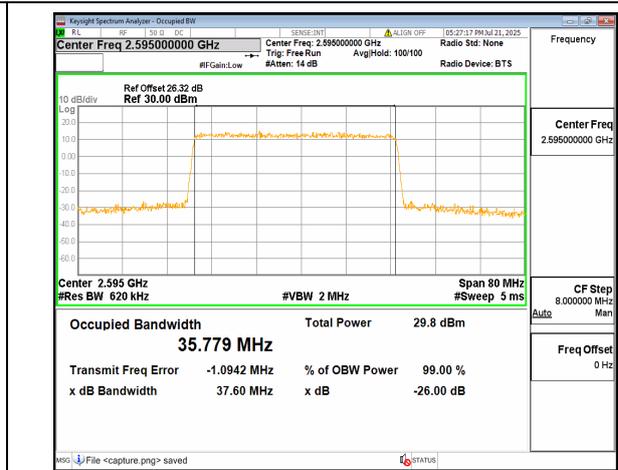Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn
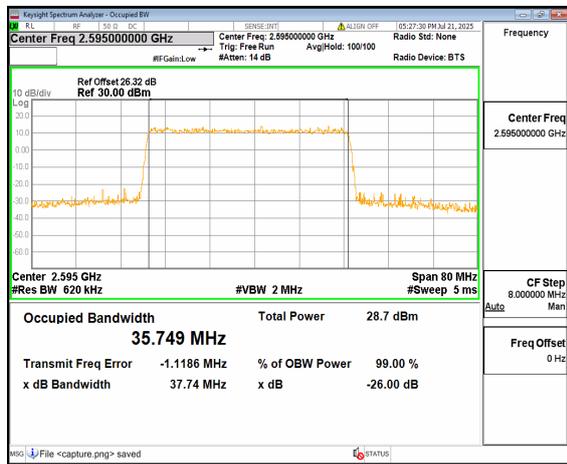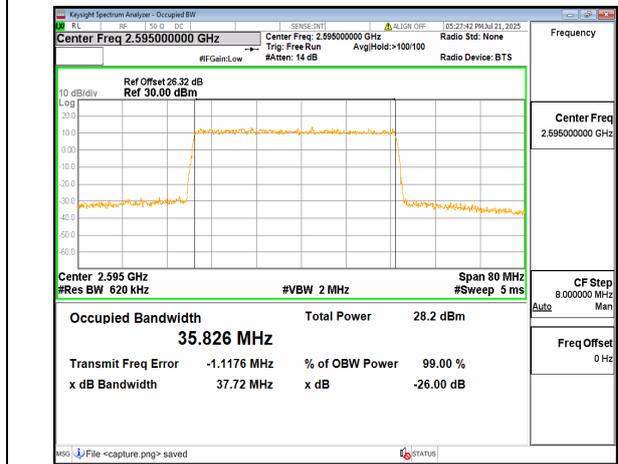
Page 239 of 873
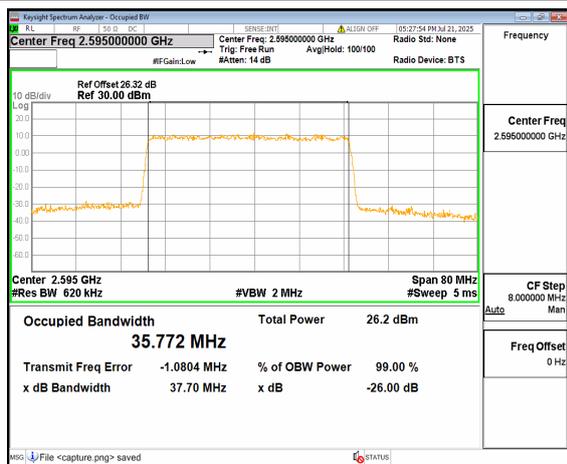
n38 40M DFT-s-OFDM BPSK Outer_Full Mid



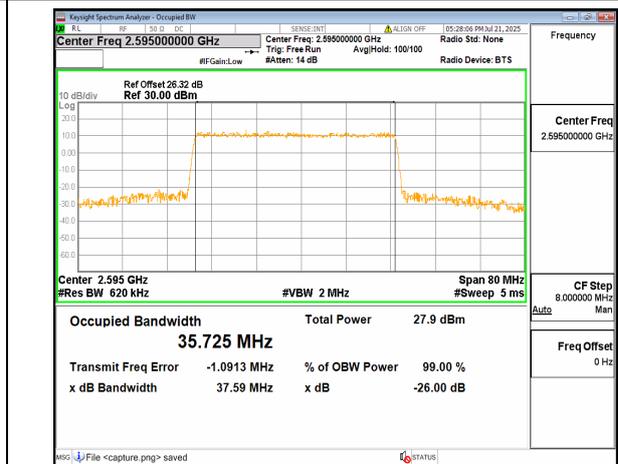n38 40M DFT-s-OFDM QPSK Outer_Full Mid
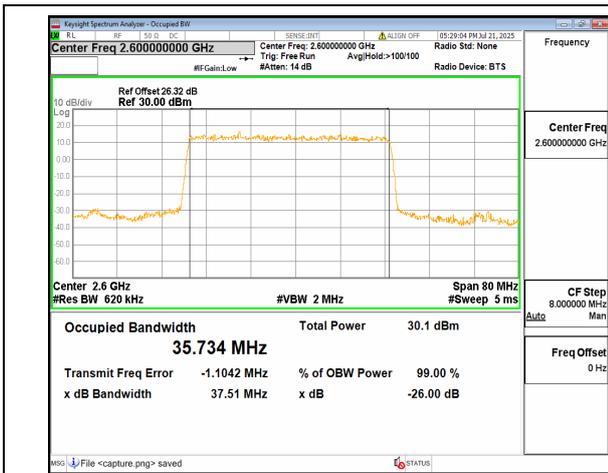


n38 40M DFT-s-OFDM 16QAM Outer_Full Mid
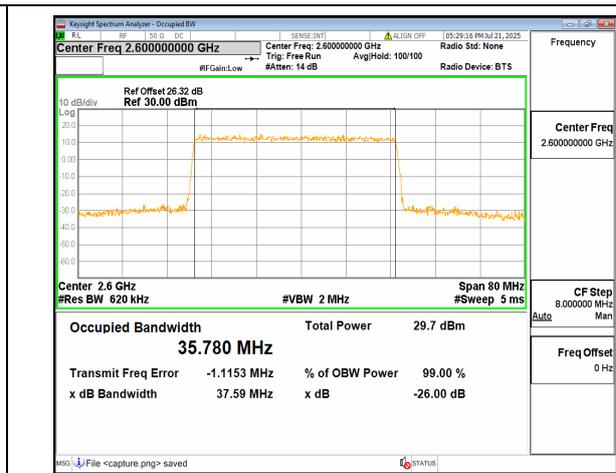


n38 40M DFT-s-OFDM 64QAM Outer_Full Mid



n38 40M DFT-s-OFDM 256QAM Outer_Full Mid



n38 40M CP-OFDM QPSK Outer_Full Mid

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555      Fax: 86-755-36698525

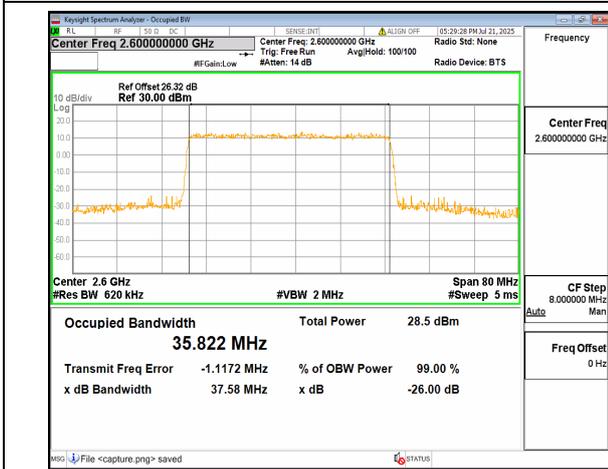Http://www.morlab.cn        E-mail: service@morlab.cn
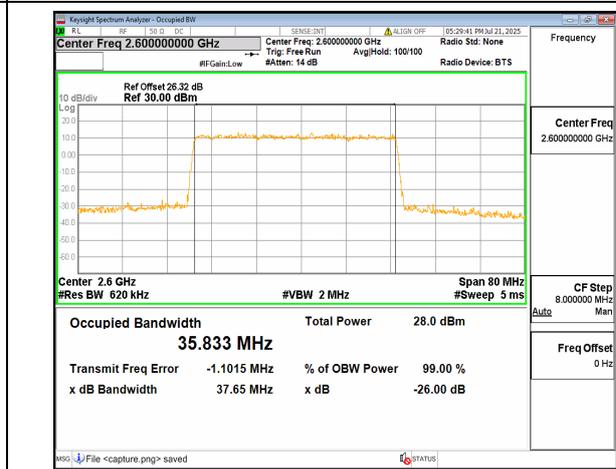
Page 240 of 873

n38 40M DFT-s-OFDM BPSK Outer_Full High
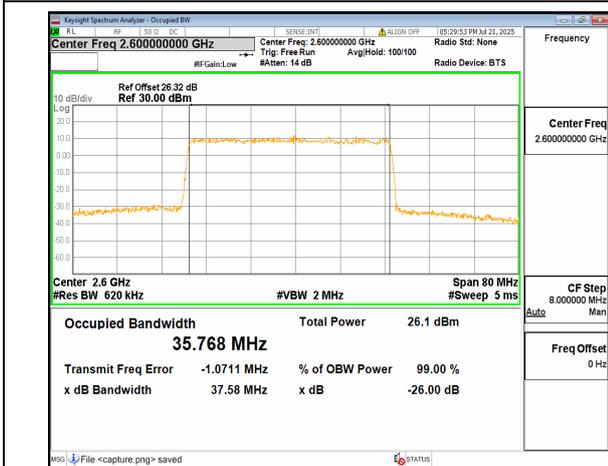


n38 40M DFT-s-OFDM QPSK Outer_Full High



n38 40M DFT-s-OFDM 16QAM Outer_Full High



n38 40M DFT-s-OFDM 64QAM Outer_Full High



n38 40M DFT-s-OFDM 256QAM Outer_Full High



n38 40M CP-OFDM QPSK Outer_Full High

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555      Fax: 86-755-36698525

Http://www.morlab.cn      E-mail: service@morlab.cn

Page **241** of **873**
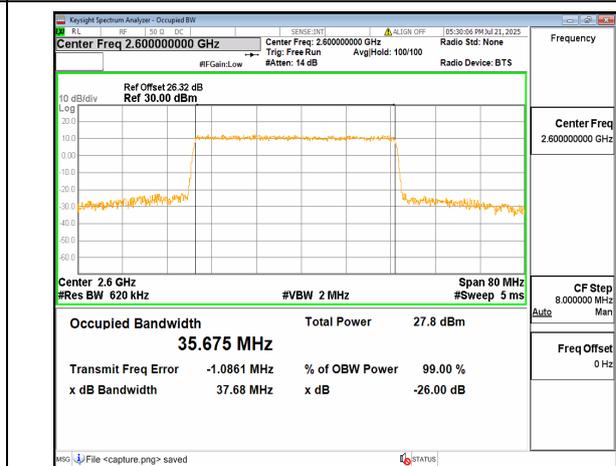
| Band | SCS (kHz) | BW (MHz) | ARFCN | Modulation | RB | OBW (MHz) | 26dB BW (MHz) | Verdict |
|---|---|---|---|---|---|---|---|---|
| n40(2305-2315MHz) | 30 | 10 | 462000 | DFT-s-OFDM PI/2 BPSK | 24/0 | 8.6030 | 9.425 | PASS |
| n40(2305-2315MHz) | 30 | 10 | 462000 | DFT-s-OFDM QPSK | 24/0 | 8.5874 | 9.261 | PASS |
| n40(2305-2315MHz) | 30 | 10 | 462000 | DFT-s-OFDM 16QAM | 24/0 | 8.5858 | 9.312 | PASS |
| n40(2305-2315MHz) | 30 | 10 | 462000 | DFT-s-OFDM 64QAM | 24/0 | 8.5759 | 9.232 | PASS |
| n40(2305-2315MHz) | 30 | 10 | 462000 | DFT-s-OFDM 256QAM | 24/0 | 8.5930 | 9.294 | PASS |
| n40(2305-2315MHz) | 30 | 10 | 462000 | CP-OFDM QPSK | 24/0 | 8.5740 | 9.355 | PASS |
| n40(2350-2360MHz) | 30 | 10 | 471000 | DFT-s-OFDM PI/2 BPSK | 24/0 | 8.6136 | 9.398 | PASS |
| n40(2350-2360MHz) | 30 | 10 | 471000 | DFT-s-OFDM QPSK | 24/0 | 8.5837 | 9.383 | PASS |
| n40(2350-2360MHz) | 30 | 10 | 471000 | DFT-s-OFDM 16QAM | 24/0 | 8.5834 | 9.263 | PASS |
| n40(2350-2360MHz) | 30 | 10 | 471000 | DFT-s-OFDM 64QAM | 24/0 | 8.6268 | 9.283 | PASS |
| n40(2350-2360MHz) | 30 | 10 | 471000 | DFT-s-OFDM 256QAM | 24/0 | 8.5763 | 9.284 | PASS |
| n40(2350-2360MHz) | 30 | 10 | 471000 | CP-OFDM QPSK | 24/0 | 8.5799 | 9.369 | PASS |
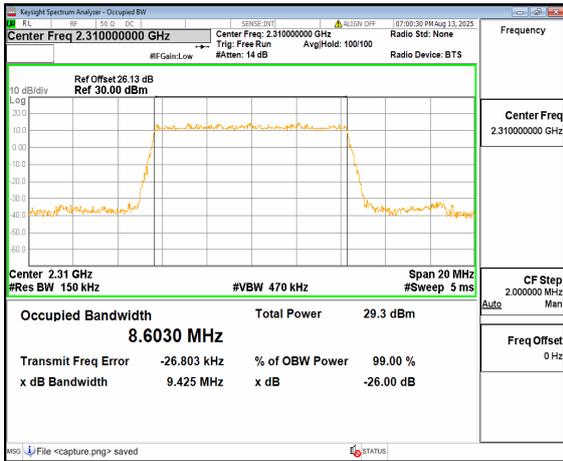
n40(2305-2315MHz) 10M DFT-s-OFDM BPSK Outer_Full Mid



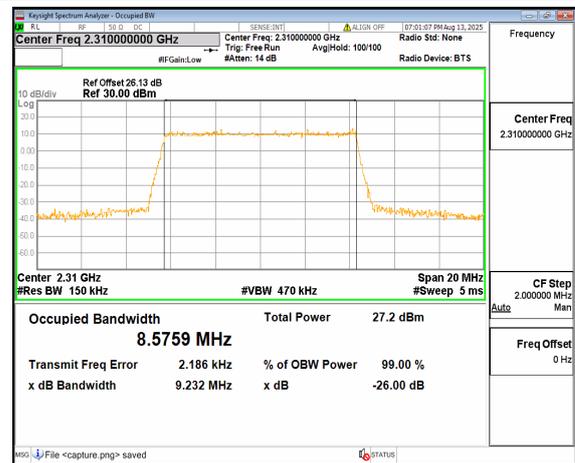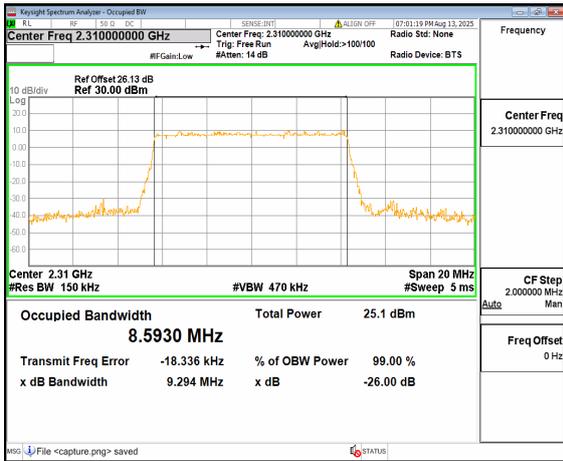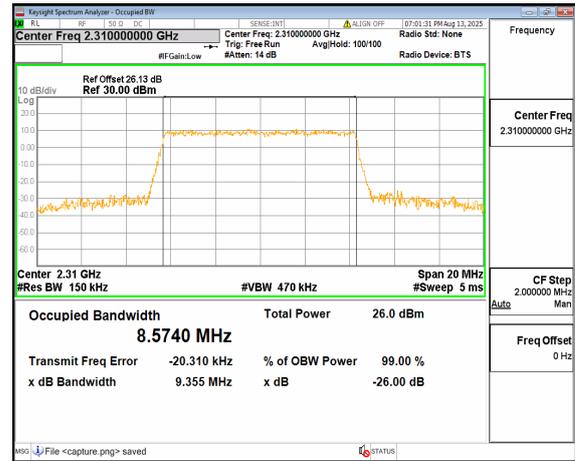n40(2305-2315MHz) 10M DFT-s-OFDM QPSK Outer_Full Mid
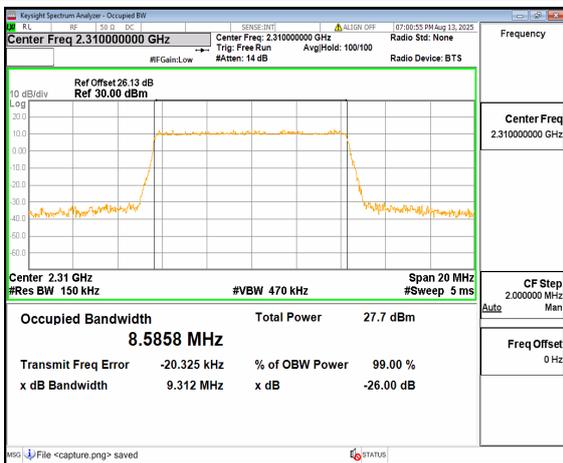


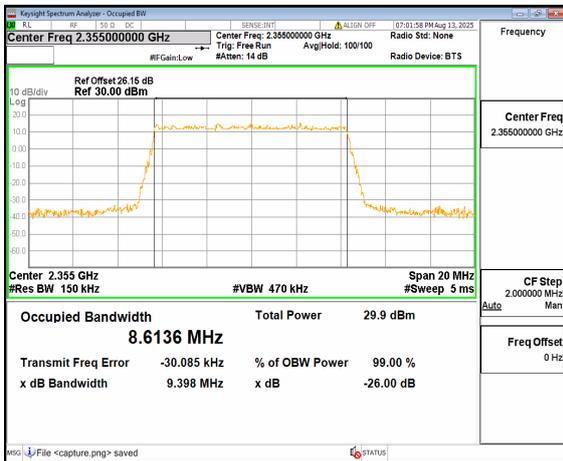n40(2305-2315MHz) 10M DFT-s-OFDM 16QAM Outer_Full Mid



n40(2305-2315MHz) 10M DFT-s-OFDM 64QAM Outer_Full Mid

n40(2305-2315MHz) 10M DFT-s-OFDM 256QAM Outer_Full Mid



n40(2305-2315MHz) 10M CP-OFDM QPSK Outer_Full Mid



n40(2350-2360MHz) 10M DFT-s-OFDM BPSK Outer_Full Mid



n40(2350-2360MHz) 10M DFT-s-OFDM QPSK Outer_Full Mid

n40(2350-2360MHz) 10M DFT-s-OFDM 16QAM Outer_Full Mid
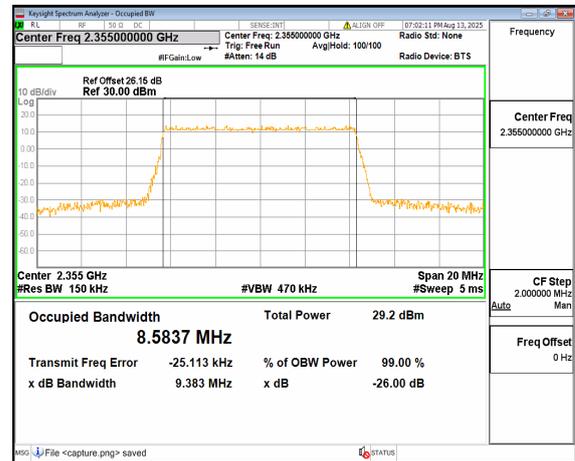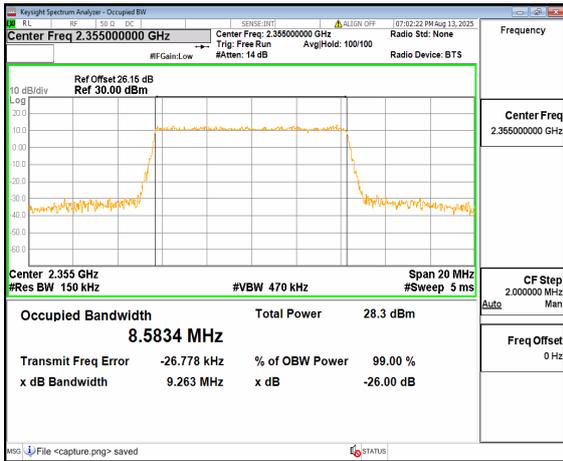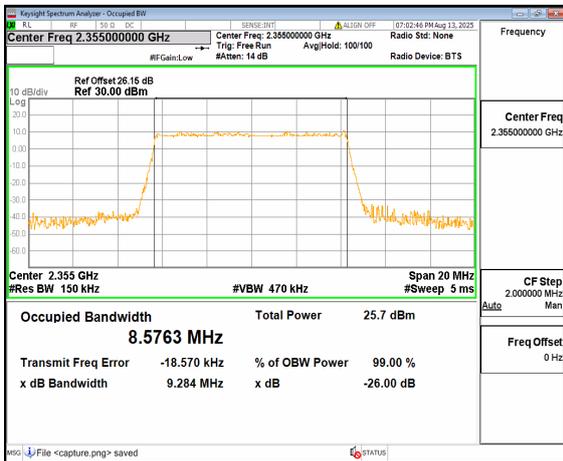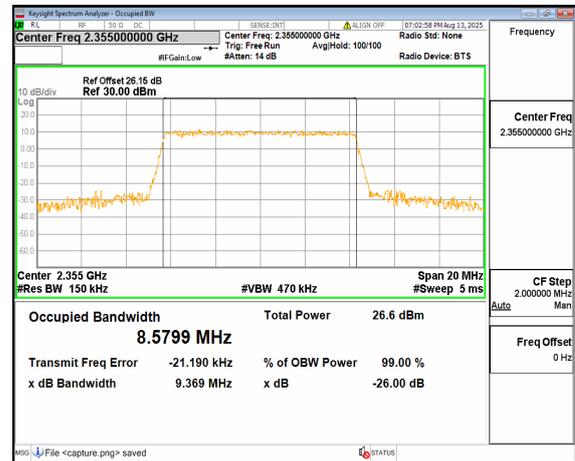


n40(2350-2360MHz) 10M DFT-s-OFDM 64QAM Outer_Full Mid



n40(2350-2360MHz) 10M DFT-s-OFDM 256QAM Outer_Full Mid



n40(2350-2360MHz) 10M CP-OFDM QPSK Outer_Full Mid

| Band | SCS (kHz) | BW (MHz) | ARFCN | Modulation | RB | OBW (MHz) | 26dB BW (MHz) | Verdict |
|------|-----------|----------|-------|------------|-----|-----------|---------------|---------|
| n41 | 30 | 10 | 500202 | DFT-s-OFDM PI/2 BPSK | 24/0 | 8.5988 | 9.346 | PASS |
| n41 | 30 | 10 | 500202 | DFT-s-OFDM QPSK | 24/0 | 8.5968 | 9.338 | PASS |
| n41 | 30 | 10 | 500202 | DFT-s-OFDM 16QAM | 24/0 | 8.5872 | 9.252 | PASS |
| n41 | 30 | 10 | 500202 | DFT-s-OFDM 64QAM | 24/0 | 8.6223 | 9.322 | PASS |
| n41 | 30 | 10 | 500202 | DFT-s-OFDM 256QAM | 24/0 | 8.5618 | 9.232 | PASS |
| n41 | 30 | 10 | 500202 | CP-OFDM QPSK | 24/0 | 8.5943 | 9.289 | PASS |
| n41 | 30 | 10 | 518598 | DFT-s-OFDM PI/2 BPSK | 24/0 | 8.6010 | 9.338 | PASS |
| n41 | 30 | 10 | 518598 | DFT-s-OFDM QPSK | 24/0 | 8.5678 | 9.372 | PASS |
| n41 | 30 | 10 | 518598 | DFT-s-OFDM 16QAM | 24/0 | 8.5825 | 9.277 | PASS |
| n41 | 30 | 10 | 518598 | DFT-s-OFDM 64QAM | 24/0 | 8.6266 | 9.364 | PASS |
| n41 | 30 | 10 | 518598 | DFT-s-OFDM 256QAM | 24/0 | 8.5839 | 9.241 | PASS |
| n41 | 30 | 10 | 518598 | CP-OFDM QPSK | 24/0 | 8.5898 | 9.401 | PASS |
| n41 | 30 | 10 | 537000 | DFT-s-OFDM PI/2 BPSK | 24/0 | 8.6055 | 9.399 | PASS |
| n41 | 30 | 10 | 537000 | DFT-s-OFDM QPSK | 24/0 | 8.5705 | 9.357 | PASS |
| n41 | 30 | 10 | 537000 | DFT-s-OFDM 16QAM | 24/0 | 8.5961 | 9.377 | PASS |
| n41 | 30 | 10 | 537000 | DFT-s-OFDM 64QAM | 24/0 | 8.6078 | 9.301 | PASS |
| n41 | 30 | 10 | 537000 | DFT-s-OFDM 256QAM | 24/0 | 8.5856 | 9.298 | PASS |
| n41 | 30 | 10 | 537000 | CP-OFDM QPSK | 24/0 | 8.5855 | 9.376 | PASS |

| n41 | 30 | 15 | 500700 | DFT-s-OFDM PI/2 BPSK | 36/0 | 12.894 | 13.786 | PASS |
|---|---|---|---|---|---|---|---|---|
| n41 | 30 | 15 | 500700 | DFT-s-OFDM QPSK | 36/0 | 12.867 | 13.818 | PASS |
| n41 | 30 | 15 | 500700 | DFT-s-OFDM 16QAM | 36/0 | 12.873 | 13.781 | PASS |
| n41 | 30 | 15 | 500700 | DFT-s-OFDM 64QAM | 36/0 | 12.897 | 13.696 | PASS |
| n41 | 30 | 15 | 500700 | DFT-s-OFDM 256QAM | 36/0 | 12.849 | 13.667 | PASS |
| n41 | 30 | 15 | 500700 | CP-OFDM QPSK | 38/0 | 12.881 | 13.788 | PASS |
| n41 | 30 | 15 | 518598 | DFT-s-OFDM PI/2 BPSK | 36/0 | 12.889 | 13.726 | PASS |
| n41 | 30 | 15 | 518598 | DFT-s-OFDM QPSK | 36/0 | 12.875 | 13.746 | PASS |
| n41 | 30 | 15 | 518598 | DFT-s-OFDM 16QAM | 36/0 | 12.857 | 13.686 | PASS |
| n41 | 30 | 15 | 518598 | DFT-s-OFDM 64QAM | 36/0 | 12.903 | 13.838 | PASS |
| n41 | 30 | 15 | 518598 | DFT-s-OFDM 256QAM | 36/0 | 12.843 | 13.722 | PASS |
| n41 | 30 | 15 | 518598 | CP-OFDM QPSK | 38/0 | 12.870 | 13.779 | PASS |
| n41 | 30 | 15 | 536496 | DFT-s-OFDM PI/2 BPSK | 36/0 | 12.895 | 13.743 | PASS |
| n41 | 30 | 15 | 536496 | DFT-s-OFDM QPSK | 36/0 | 12.868 | 13.680 | PASS |
| n41 | 30 | 15 | 536496 | DFT-s-OFDM 16QAM | 36/0 | 12.842 | 13.818 | PASS |
| n41 | 30 | 15 | 536496 | DFT-s-OFDM 64QAM | 36/0 | 12.888 | 13.872 | PASS |
| n41 | 30 | 15 | 536496 | DFT-s-OFDM 256QAM | 36/0 | 12.843 | 13.725 | PASS |
| n41 | 30 | 15 | 536496 | CP-OFDM QPSK | 38/0 | 12.868 | 13.783 | PASS |
| n41 | 30 | 20 | 501204 | DFT-s-OFDM PI/2 BPSK | 50/0 | 17.899 | 18.886 | PASS |

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page **247** of **873**

| n41 | 30 | 20 | 501204 | DFT-s-OFDM QPSK | 50/0 | 17.910 | 18.923 | PASS |
|---|---|---|---|---|---|---|---|---|
| n41 | 30 | 20 | 501204 | DFT-s-OFDM 16QAM | 50/0 | 17.854 | 18.794 | PASS |
| n41 | 30 | 20 | 501204 | DFT-s-OFDM 64QAM | 50/0 | 17.910 | 18.913 | PASS |
| n41 | 30 | 20 | 501204 | DFT-s-OFDM 256QAM | 50/0 | 17.842 | 18.834 | PASS |
| n41 | 30 | 20 | 501204 | CP-OFDM QPSK | 51/0 | 17.890 | 18.897 | PASS |
| n41 | 30 | 20 | 518598 | DFT-s-OFDM PI/2 BPSK | 50/0 | 17.921 | 18.935 | PASS |
| n41 | 30 | 20 | 518598 | DFT-s-OFDM QPSK | 50/0 | 17.854 | 18.915 | PASS |
| n41 | 30 | 20 | 518598 | DFT-s-OFDM 16QAM | 50/0 | 17.860 | 18.830 | PASS |
| n41 | 30 | 20 | 518598 | DFT-s-OFDM 64QAM | 50/0 | 17.894 | 18.992 | PASS |
| n41 | 30 | 20 | 518598 | DFT-s-OFDM 256QAM | 50/0 | 17.847 | 18.863 | PASS |
| n41 | 30 | 20 | 518598 | CP-OFDM QPSK | 51/0 | 17.882 | 18.893 | PASS |
| n41 | 30 | 20 | 535998 | DFT-s-OFDM PI/2 BPSK | 50/0 | 17.915 | 18.780 | PASS |
| n41 | 30 | 20 | 535998 | DFT-s-OFDM QPSK | 50/0 | 17.829 | 18.892 | PASS |
| n41 | 30 | 20 | 535998 | DFT-s-OFDM 16QAM | 50/0 | 17.872 | 18.865 | PASS |
| n41 | 30 | 20 | 535998 | DFT-s-OFDM 64QAM | 50/0 | 17.899 | 18.968 | PASS |
| n41 | 30 | 20 | 535998 | DFT-s-OFDM 256QAM | 50/0 | 17.871 | 18.812 | PASS |
| n41 | 30 | 20 | 535998 | CP-OFDM QPSK | 51/0 | 17.878 | 18.959 | PASS |
| n41 | 30 | 30 | 502200 | DFT-s-OFDM PI/2 BPSK | 75/0 | 26.908 | 28.413 | PASS |
| n41 | 30 | 30 | 502200 | DFT-s-OFDM QPSK | 75/0 | 26.871 | 28.553 | PASS |

| n41 | 30 | 30 | 502200 | DFT-s-OFDM 16QAM | 75/0 | 26.851 | 28.425 | PASS |
|------|----|----|--------|-----------------|------|--------|--------|------|
| n41 | 30 | 30 | 502200 | DFT-s-OFDM 64QAM | 75/0 | 26.881 | 28.381 | PASS |
| n41 | 30 | 30 | 502200 | DFT-s-OFDM 256QAM | 75/0 | 26.888 | 28.516 | PASS |
| n41 | 30 | 30 | 502200 | CP-OFDM QPSK | 78/0 | 26.895 | 28.487 | PASS |
| n41 | 30 | 30 | 518598 | DFT-s-OFDM PI/2 BPSK | 75/0 | 26.825 | 28.381 | PASS |
| n41 | 30 | 30 | 518598 | DFT-s-OFDM QPSK | 75/0 | 26.871 | 28.416 | PASS |
| n41 | 30 | 30 | 518598 | DFT-s-OFDM 16QAM | 75/0 | 26.843 | 28.475 | PASS |
| n41 | 30 | 30 | 518598 | DFT-s-OFDM 64QAM | 75/0 | 26.879 | 28.420 | PASS |
| n41 | 30 | 30 | 518598 | DFT-s-OFDM 256QAM | 75/0 | 26.891 | 28.342 | PASS |
| n41 | 30 | 30 | 518598 | CP-OFDM QPSK | 78/0 | 26.873 | 28.472 | PASS |
| n41 | 30 | 30 | 534996 | DFT-s-OFDM PI/2 BPSK | 75/0 | 26.865 | 28.401 | PASS |
| n41 | 30 | 30 | 534996 | DFT-s-OFDM QPSK | 75/0 | 26.855 | 28.293 | PASS |
| n41 | 30 | 30 | 534996 | DFT-s-OFDM 16QAM | 75/0 | 26.813 | 28.344 | PASS |
| n41 | 30 | 30 | 534996 | DFT-s-OFDM 64QAM | 75/0 | 26.868 | 28.509 | PASS |
| n41 | 30 | 30 | 534996 | DFT-s-OFDM 256QAM | 75/0 | 26.837 | 28.328 | PASS |
| n41 | 30 | 30 | 534996 | CP-OFDM QPSK | 78/0 | 26.805 | 28.405 | PASS |
| n41 | 30 | 40 | 503202 | DFT-s-OFDM PI/2 BPSK | 100/0 | 35.774 | 37.697 | PASS |
| n41 | 30 | 40 | 503202 | DFT-s-OFDM QPSK | 100/0 | 35.813 | 37.646 | PASS |
| n41 | 30 | 40 | 503202 | DFT-s-OFDM 16QAM | 100/0 | 35.762 | 37.620 | PASS |

**MORLAB**

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page **249** of **873**

| n41 | 30 | 40 | 503202 | DFT-s-OFDM 64QAM | 100/0 | 35.833 | 37.607 | PASS |
|---|---|---|---|---|---|---|---|---|
| n41 | 30 | 40 | 503202 | DFT-s-OFDM 256QAM | 100/0 | 35.752 | 37.657 | PASS |
| n41 | 30 | 40 | 503202 | CP-OFDM QPSK | 106/0 | 35.729 | 37.650 | PASS |
| n41 | 30 | 40 | 518598 | DFT-s-OFDM PI/2 BPSK | 100/0 | 35.777 | 37.642 | PASS |
| n41 | 30 | 40 | 518598 | DFT-s-OFDM QPSK | 100/0 | 35.790 | 37.627 | PASS |
| n41 | 30 | 40 | 518598 | DFT-s-OFDM 16QAM | 100/0 | 35.773 | 37.592 | PASS |
| n41 | 30 | 40 | 518598 | DFT-s-OFDM 64QAM | 100/0 | 35.852 | 37.714 | PASS |
| n41 | 30 | 40 | 518598 | DFT-s-OFDM 256QAM | 100/0 | 35.773 | 37.502 | PASS |
| n41 | 30 | 40 | 518598 | CP-OFDM QPSK | 106/0 | 35.718 | 37.653 | PASS |
| n41 | 30 | 40 | 534000 | DFT-s-OFDM PI/2 BPSK | 100/0 | 35.750 | 37.551 | PASS |
| n41 | 30 | 40 | 534000 | DFT-s-OFDM QPSK | 100/0 | 35.752 | 37.635 | PASS |
| n41 | 30 | 40 | 534000 | DFT-s-OFDM 16QAM | 100/0 | 35.714 | 37.608 | PASS |
| n41 | 30 | 40 | 534000 | DFT-s-OFDM 64QAM | 100/0 | 35.796 | 37.687 | PASS |
| n41 | 30 | 40 | 534000 | DFT-s-OFDM 256QAM | 100/0 | 35.713 | 37.506 | PASS |
| n41 | 30 | 40 | 534000 | CP-OFDM QPSK | 106/0 | 35.703 | 37.686 | PASS |
| n41 | 30 | 50 | 504204 | DFT-s-OFDM PI/2 BPSK | 128/0 | 45.772 | 47.814 | PASS |
| n41 | 30 | 50 | 504204 | DFT-s-OFDM QPSK | 128/0 | 45.744 | 47.817 | PASS |
| n41 | 30 | 50 | 504204 | DFT-s-OFDM 16QAM | 128/0 | 45.696 | 47.930 | PASS |
| n41 | 30 | 50 | 504204 | DFT-s-OFDM 64QAM | 128/0 | 45.714 | 47.788 | PASS |

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road, Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525
Http://www.morlab.cn    E-mail: service@morlab.cn

Page 250 of 873

| n41 | 30 | 50 | 504204 | DFT-s-OFDM 256QAM | 128/0 | 45.673 | 47.749 | PASS |
|---|---|---|---|---|---|---|---|---|
| n41 | 30 | 50 | 504204 | CP-OFDM QPSK | 133/0 | 45.609 | 47.938 | PASS |
| n41 | 30 | 50 | 518598 | DFT-s-OFDM PI/2 BPSK | 128/0 | 45.719 | 47.904 | PASS |
| n41 | 30 | 50 | 518598 | DFT-s-OFDM QPSK | 128/0 | 45.700 | 47.868 | PASS |
| n41 | 30 | 50 | 518598 | DFT-s-OFDM 16QAM | 128/0 | 45.692 | 47.794 | PASS |
| n41 | 30 | 50 | 518598 | DFT-s-OFDM 64QAM | 128/0 | 45.724 | 47.740 | PASS |
| n41 | 30 | 50 | 518598 | DFT-s-OFDM 256QAM | 128/0 | 45.679 | 47.811 | PASS |
| n41 | 30 | 50 | 518598 | CP-OFDM QPSK | 133/0 | 45.726 | 48.022 | PASS |
| n41 | 30 | 50 | 532998 | DFT-s-OFDM PI/2 BPSK | 128/0 | 45.718 | 47.986 | PASS |
| n41 | 30 | 50 | 532998 | DFT-s-OFDM QPSK | 128/0 | 45.674 | 47.969 | PASS |
| n41 | 30 | 50 | 532998 | DFT-s-OFDM 16QAM | 128/0 | 45.674 | 47.753 | PASS |
| n41 | 30 | 50 | 532998 | DFT-s-OFDM 64QAM | 128/0 | 45.655 | 47.791 | PASS |
| n41 | 30 | 50 | 532998 | DFT-s-OFDM 256QAM | 128/0 | 45.616 | 47.717 | PASS |
| n41 | 30 | 50 | 532998 | CP-OFDM QPSK | 133/0 | 45.659 | 47.778 | PASS |
| n41 | 30 | 60 | 505200 | DFT-s-OFDM PI/2 BPSK | 162/0 | 57.864 | 60.330 | PASS |
| n41 | 30 | 60 | 505200 | DFT-s-OFDM QPSK | 162/0 | 57.887 | 60.450 | PASS |
| n41 | 30 | 60 | 505200 | DFT-s-OFDM 16QAM | 162/0 | 57.809 | 60.372 | PASS |
| n41 | 30 | 60 | 505200 | DFT-s-OFDM 64QAM | 162/0 | 57.821 | 60.431 | PASS |
| n41 | 30 | 60 | 505200 | DFT-s-OFDM 256QAM | 162/0 | 57.734 | 60.371 | PASS |

| n41 | 30 | 60 | 505200 | CP-OFDM QPSK | 162/0 | 57.781 | 60.326 | PASS |
|-----|----|----|--------|--------------|-------|--------|--------|------|
| n41 | 30 | 60 | 518598 | DFT-s-OFDM PI/2 BPSK | 162/0 | 57.852 | 60.334 | PASS |
| n41 | 30 | 60 | 518598 | DFT-s-OFDM QPSK | 162/0 | 57.807 | 60.432 | PASS |
| n41 | 30 | 60 | 518598 | DFT-s-OFDM 16QAM | 162/0 | 57.836 | 60.332 | PASS |
| n41 | 30 | 60 | 518598 | DFT-s-OFDM 64QAM | 162/0 | 57.846 | 60.368 | PASS |
| n41 | 30 | 60 | 518598 | DFT-s-OFDM 256QAM | 162/0 | 57.801 | 60.384 | PASS |
| n41 | 30 | 60 | 518598 | CP-OFDM QPSK | 162/0 | 57.771 | 60.330 | PASS |
| n41 | 30 | 60 | 531996 | DFT-s-OFDM PI/2 BPSK | 162/0 | 57.847 | 60.333 | PASS |
| n41 | 30 | 60 | 531996 | DFT-s-OFDM QPSK | 162/0 | 57.902 | 60.462 | PASS |
| n41 | 30 | 60 | 531996 | DFT-s-OFDM 16QAM | 162/0 | 57.839 | 60.320 | PASS |
| n41 | 30 | 60 | 531996 | DFT-s-OFDM 64QAM | 162/0 | 57.906 | 60.436 | PASS |
| n41 | 30 | 60 | 531996 | DFT-s-OFDM 256QAM | 162/0 | 57.765 | 60.322 | PASS |
| n41 | 30 | 60 | 531996 | CP-OFDM QPSK | 162/0 | 57.766 | 60.324 | PASS |
| n41 | 30 | 70 | 506202 | DFT-s-OFDM PI/2 BPSK | 180/0 | 64.252 | 67.121 | PASS |
| n41 | 30 | 70 | 506202 | DFT-s-OFDM QPSK | 180/0 | 64.319 | 67.271 | PASS |
| n41 | 30 | 70 | 506202 | DFT-s-OFDM 16QAM | 180/0 | 64.218 | 67.235 | PASS |
| n41 | 30 | 70 | 506202 | DFT-s-OFDM 64QAM | 180/0 | 64.371 | 67.278 | PASS |
| n41 | 30 | 70 | 506202 | DFT-s-OFDM 256QAM | 180/0 | 64.252 | 67.186 | PASS |
| n41 | 30 | 70 | 506202 | CP-OFDM QPSK | 189/0 | 64.284 | 67.211 | PASS |

**MORLAB**

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page **252** of **873**

| n41 | 30 | 70 | 518598 | DFT-s-OFDM PI/2 BPSK | 180/0 | 64.269 | 67.192 | PASS |
|---|---|---|---|---|---|---|---|---|
| n41 | 30 | 70 | 518598 | DFT-s-OFDM QPSK | 180/0 | 64.319 | 67.251 | PASS |
| n41 | 30 | 70 | 518598 | DFT-s-OFDM 16QAM | 180/0 | 64.284 | 67.224 | PASS |
| n41 | 30 | 70 | 518598 | DFT-s-OFDM 64QAM | 180/0 | 64.356 | 67.297 | PASS |
| n41 | 30 | 70 | 518598 | DFT-s-OFDM 256QAM | 180/0 | 64.209 | 67.202 | PASS |
| n41 | 30 | 70 | 518598 | CP-OFDM QPSK | 189/0 | 64.240 | 67.235 | PASS |
| n41 | 30 | 70 | 531000 | DFT-s-OFDM PI/2 BPSK | 180/0 | 64.314 | 67.222 | PASS |
| n41 | 30 | 70 | 531000 | DFT-s-OFDM QPSK | 180/0 | 64.284 | 67.284 | PASS |
| n41 | 30 | 70 | 531000 | DFT-s-OFDM 16QAM | 180/0 | 64.260 | 67.149 | PASS |
| n41 | 30 | 70 | 531000 | DFT-s-OFDM 64QAM | 180/0 | 64.285 | 67.295 | PASS |
| n41 | 30 | 70 | 531000 | DFT-s-OFDM 256QAM | 180/0 | 64.291 | 67.245 | PASS |
| n41 | 30 | 70 | 531000 | CP-OFDM QPSK | 189/0 | 64.263 | 67.231 | PASS |
| n41 | 30 | 80 | 507204 | DFT-s-OFDM PI/2 BPSK | 216/0 | 77.156 | 80.464 | PASS |
| n41 | 30 | 80 | 507204 | DFT-s-OFDM QPSK | 216/0 | 77.124 | 80.520 | PASS |
| n41 | 30 | 80 | 507204 | DFT-s-OFDM 16QAM | 216/0 | 76.911 | 80.439 | PASS |
| n41 | 30 | 80 | 507204 | DFT-s-OFDM 64QAM | 216/0 | 77.132 | 80.400 | PASS |
| n41 | 30 | 80 | 507204 | DFT-s-OFDM 256QAM | 216/0 | 77.039 | 80.379 | PASS |
| n41 | 30 | 80 | 507204 | CP-OFDM QPSK | 217/0 | 77.081 | 80.452 | PASS |
| n41 | 30 | 80 | 518598 | DFT-s-OFDM PI/2 BPSK | 216/0 | 77.046 | 80.481 | PASS |

MORLAB

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page 253 of 873

| n41 | 30 | 80 | 518598 | DFT-s-OFDM QPSK | 216/0 | 77.093 | 80.387 | PASS |
|---|---|---|---|---|---|---|---|---|
| n41 | 30 | 80 | 518598 | DFT-s-OFDM 16QAM | 216/0 | 76.998 | 80.470 | PASS |
| n41 | 30 | 80 | 518598 | DFT-s-OFDM 64QAM | 216/0 | 77.091 | 80.416 | PASS |
| n41 | 30 | 80 | 518598 | DFT-s-OFDM 256QAM | 216/0 | 77.048 | 80.390 | PASS |
| n41 | 30 | 80 | 518598 | CP-OFDM QPSK | 217/0 | 77.112 | 80.466 | PASS |
| n41 | 30 | 80 | 529998 | DFT-s-OFDM PI/2 BPSK | 216/0 | 77.136 | 80.490 | PASS |
| n41 | 30 | 80 | 529998 | DFT-s-OFDM QPSK | 216/0 | 77.050 | 80.446 | PASS |
| n41 | 30 | 80 | 529998 | DFT-s-OFDM 16QAM | 216/0 | 76.949 | 80.366 | PASS |
| n41 | 30 | 80 | 529998 | DFT-s-OFDM 64QAM | 216/0 | 77.114 | 80.479 | PASS |
| n41 | 30 | 80 | 529998 | DFT-s-OFDM 256QAM | 216/0 | 77.032 | 80.393 | PASS |
| n41 | 30 | 80 | 529998 | CP-OFDM QPSK | 217/0 | 77.003 | 80.411 | PASS |
| n41 | 30 | 90 | 508200 | DFT-s-OFDM PI/2 BPSK | 243/0 | 86.703 | 90.341 | PASS |
| n41 | 30 | 90 | 508200 | DFT-s-OFDM QPSK | 243/0 | 86.846 | 90.486 | PASS |
| n41 | 30 | 90 | 508200 | DFT-s-OFDM 16QAM | 243/0 | 86.650 | 90.326 | PASS |
| n41 | 30 | 90 | 508200 | DFT-s-OFDM 64QAM | 243/0 | 86.643 | 90.356 | PASS |
| n41 | 30 | 90 | 508200 | DFT-s-OFDM 256QAM | 243/0 | 86.729 | 90.265 | PASS |
| n41 | 30 | 90 | 508200 | CP-OFDM QPSK | 245/0 | 86.702 | 90.319 | PASS |
| n41 | 30 | 90 | 518598 | DFT-s-OFDM PI/2 BPSK | 243/0 | 86.844 | 90.366 | PASS |
| n41 | 30 | 90 | 518598 | DFT-s-OFDM QPSK | 243/0 | 86.593 | 90.361 | PASS |

**MORLAB**

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page **254** of **873**

| n41 | 30 | 90 | 518598 | DFT-s-OFDM 16QAM | 243/0 | 86.673 | 90.291 | PASS |
|---|---|---|---|---|---|---|---|---|
| n41 | 30 | 90 | 518598 | DFT-s-OFDM 64QAM | 243/0 | 86.714 | 90.406 | PASS |
| n41 | 30 | 90 | 518598 | DFT-s-OFDM 256QAM | 243/0 | 86.737 | 90.345 | PASS |
| n41 | 30 | 90 | 518598 | CP-OFDM QPSK | 245/0 | 86.718 | 90.304 | PASS |
| n41 | 30 | 90 | 528996 | DFT-s-OFDM PI/2 BPSK | 243/0 | 86.826 | 90.477 | PASS |
| n41 | 30 | 90 | 528996 | DFT-s-OFDM QPSK | 243/0 | 86.772 | 90.405 | PASS |
| n41 | 30 | 90 | 528996 | DFT-s-OFDM 16QAM | 243/0 | 86.649 | 90.291 | PASS |
| n41 | 30 | 90 | 528996 | DFT-s-OFDM 64QAM | 243/0 | 86.729 | 90.396 | PASS |
| n41 | 30 | 90 | 528996 | DFT-s-OFDM 256QAM | 243/0 | 86.771 | 90.320 | PASS |
| n41 | 30 | 90 | 528996 | CP-OFDM QPSK | 245/0 | 86.846 | 90.397 | PASS |
| n41 | 30 | 100 | 509202 | DFT-s-OFDM PI/2 BPSK | 270/0 | 96.472 | 100.594 | PASS |
| n41 | 30 | 100 | 509202 | DFT-s-OFDM QPSK | 270/0 | 96.279 | 100.580 | PASS |
| n41 | 30 | 100 | 509202 | DFT-s-OFDM 16QAM | 270/0 | 96.209 | 100.461 | PASS |
| n41 | 30 | 100 | 509202 | DFT-s-OFDM 64QAM | 270/0 | 96.388 | 100.508 | PASS |
| n41 | 30 | 100 | 509202 | DFT-s-OFDM 256QAM | 270/0 | 96.481 | 100.501 | PASS |
| n41 | 30 | 100 | 509202 | CP-OFDM QPSK | 273/0 | 96.299 | 100.361 | PASS |
| n41 | 30 | 100 | 518598 | DFT-s-OFDM PI/2 BPSK | 270/0 | 96.331 | 100.480 | PASS |
| n41 | 30 | 100 | 518598 | DFT-s-OFDM QPSK | 270/0 | 96.520 | 100.577 | PASS |
| n41 | 30 | 100 | 518598 | DFT-s-OFDM 16QAM | 270/0 | 96.212 | 100.549 | PASS |

**MORLAB**

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page **255** of **873**

| n41 | 30 | 100 | 518598 | DFT-s-OFDM 64QAM | 270/0 | 96.309 | 100.593 | PASS |
|-----|-----|-----|--------|------------------|-------|--------|---------|------|
| n41 | 30 | 100 | 518598 | DFT-s-OFDM 256QAM | 270/0 | 96.398 | 100.603 | PASS |
| n41 | 30 | 100 | 518598 | CP-OFDM QPSK | 273/0 | 96.325 | 100.493 | PASS |
| n41 | 30 | 100 | 528000 | DFT-s-OFDM PI/2 BPSK | 270/0 | 96.339 | 100.517 | PASS |
| n41 | 30 | 100 | 528000 | DFT-s-OFDM QPSK | 270/0 | 96.286 | 100.523 | PASS |
| n41 | 30 | 100 | 528000 | DFT-s-OFDM 16QAM | 270/0 | 96.275 | 100.453 | PASS |
| n41 | 30 | 100 | 528000 | DFT-s-OFDM 64QAM | 270/0 | 96.419 | 100.513 | PASS |
| n41 | 30 | 100 | 528000 | DFT-s-OFDM 256QAM | 270/0 | 96.576 | 100.516 | PASS |
| n41 | 30 | 100 | 528000 | CP-OFDM QPSK | 273/0 | 96.315 | 100.423 | PASS |

**MORLAB**

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page **256** of **873**
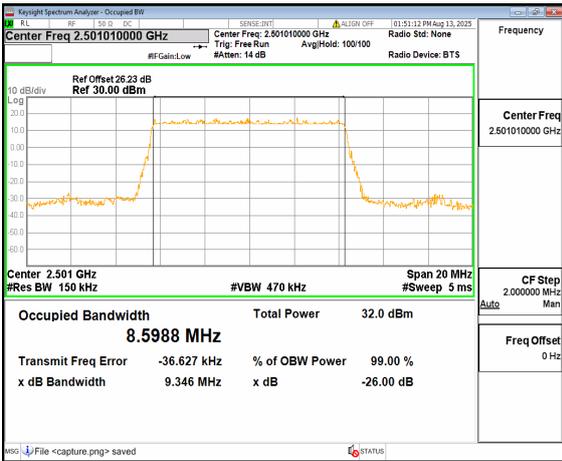
n41 10M DFT-s-OFDM BPSK Outer_Full Low
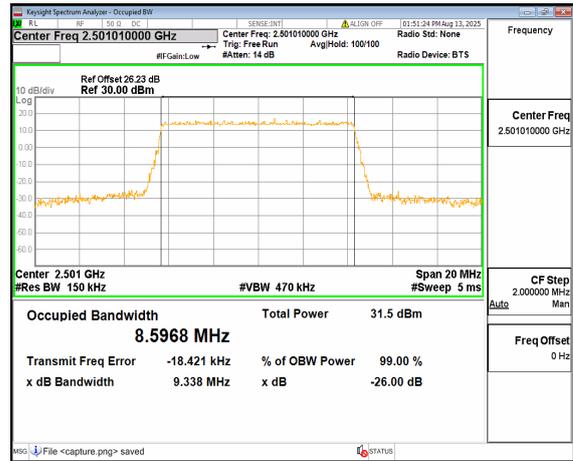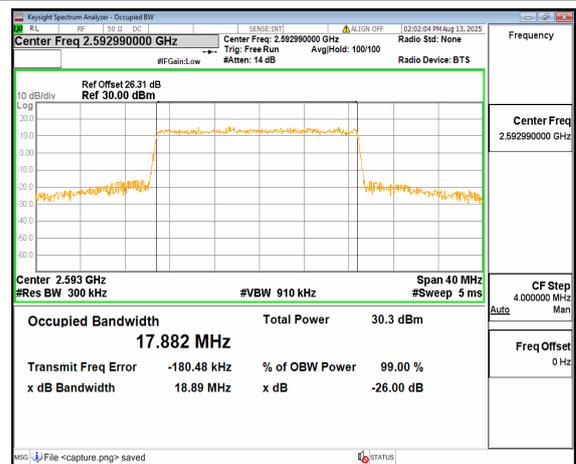


n41 10M DFT-s-OFDM QPSK Outer_Full Low
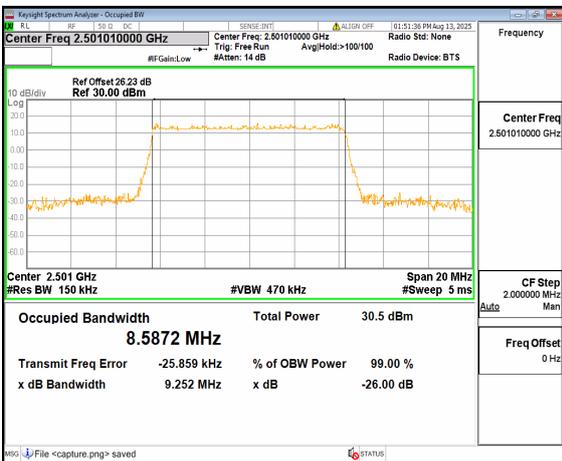


n41 10M DFT-s-OFDM 16QAM Outer_Full Low
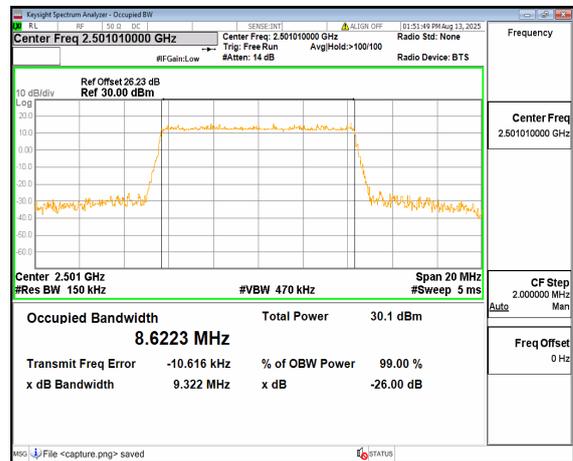
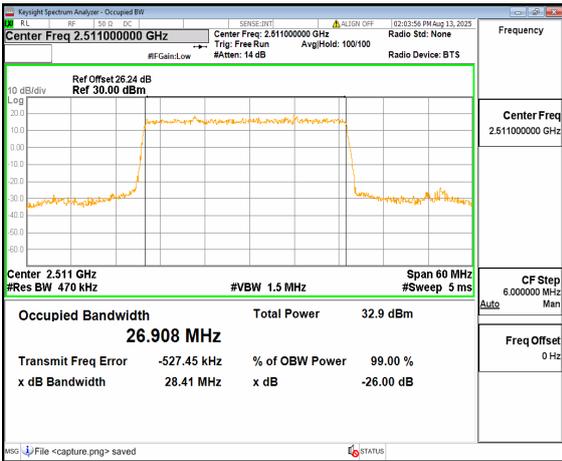

n41 10M DFT-s-OFDM 64QAM Outer_Full Low
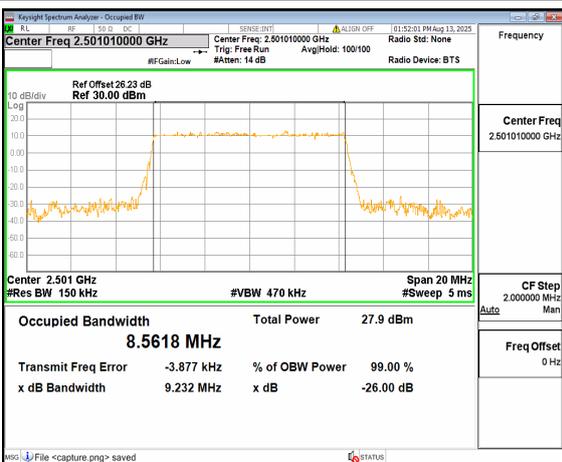


n41 10M DFT-s-OFDM 256QAM Outer_Full Low
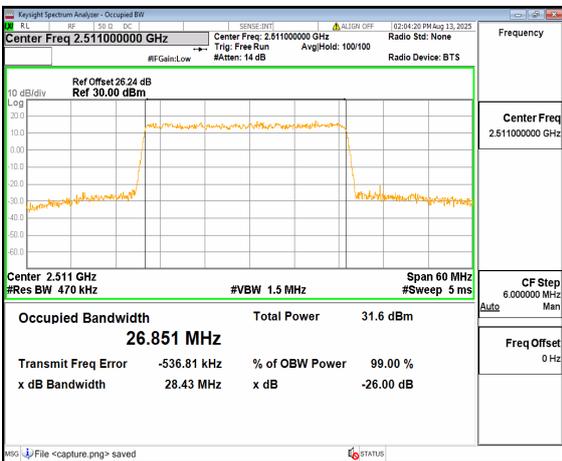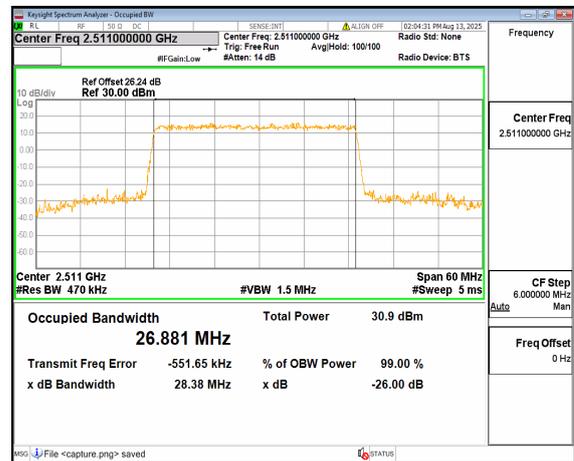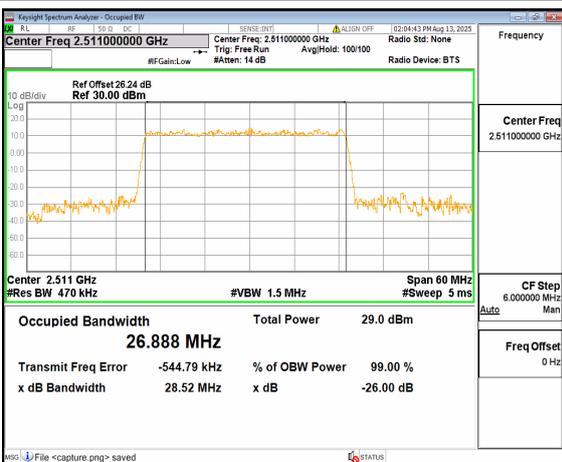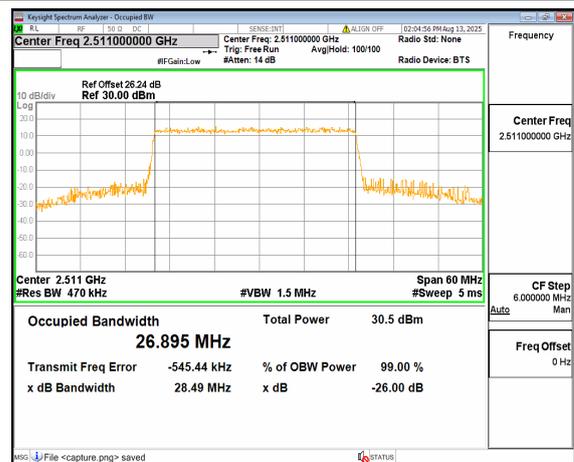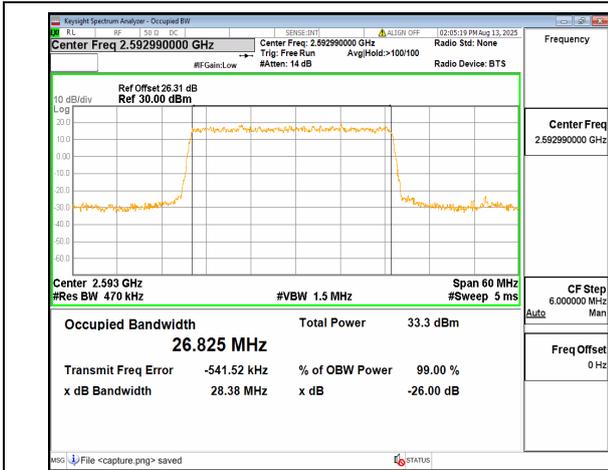


n41 10M CP-OFDM QPSK Outer_Full Low

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page **257** of **873**
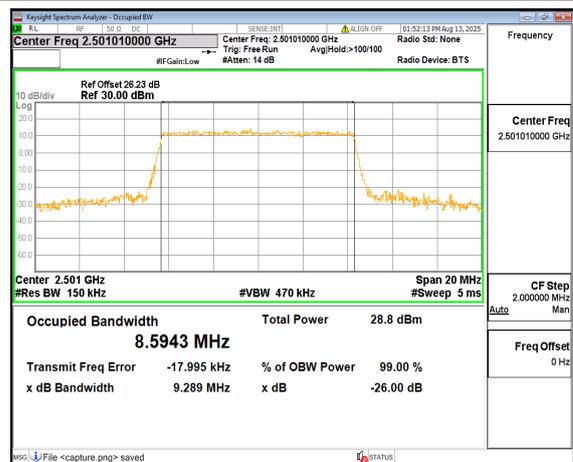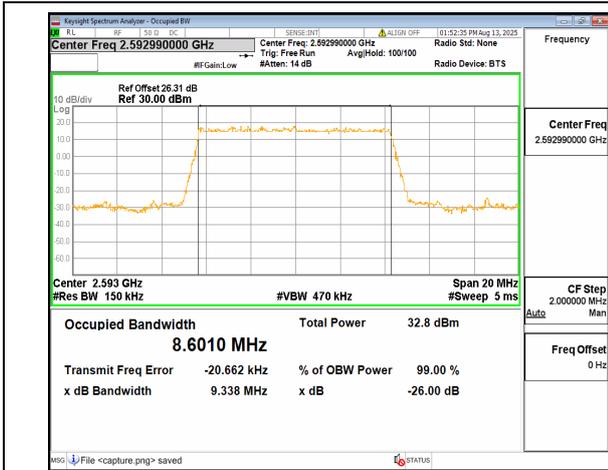
n41 10M DFT-s-OFDM BPSK Outer_Full Mid
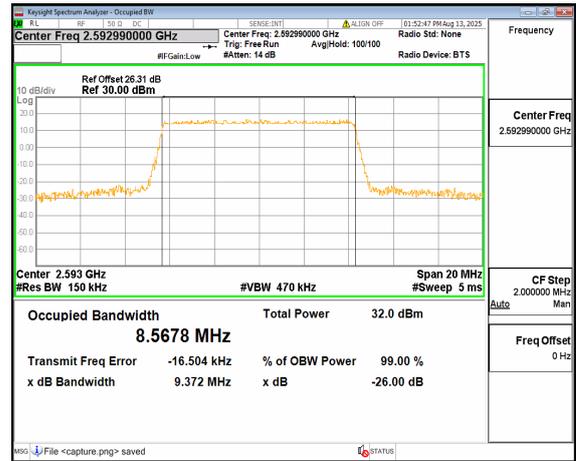


n41 10M DFT-s-OFDM QPSK Outer_Full Mid
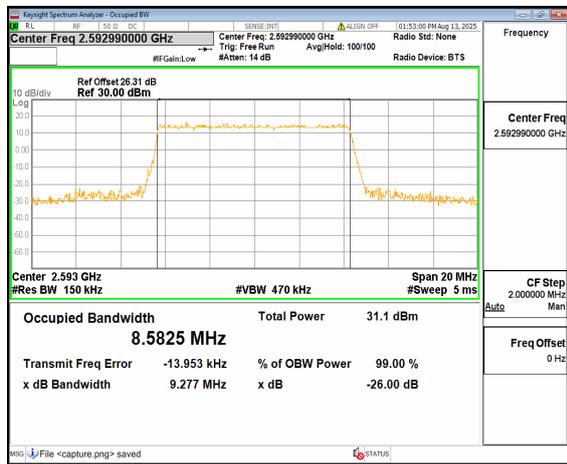


n41 10M DFT-s-OFDM 16QAM Outer_Full Mid
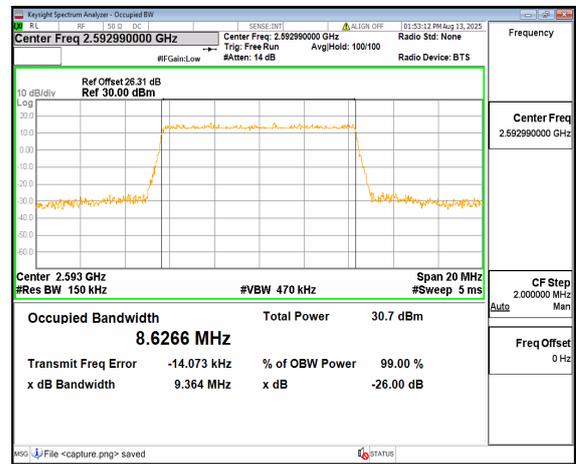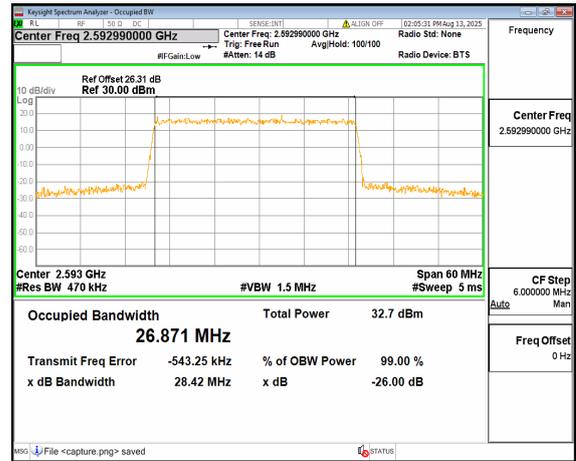


n41 10M DFT-s-OFDM 64QAM Outer_Full Mid
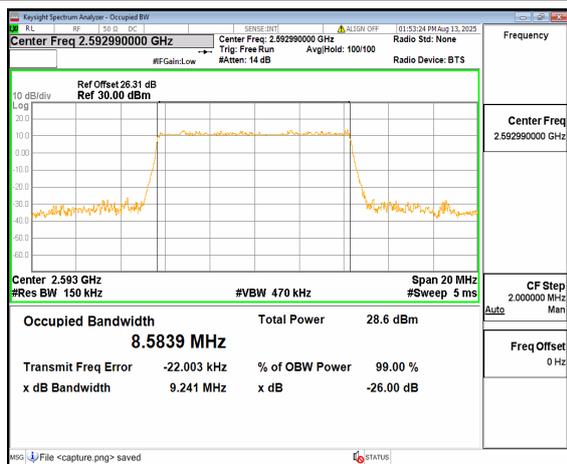


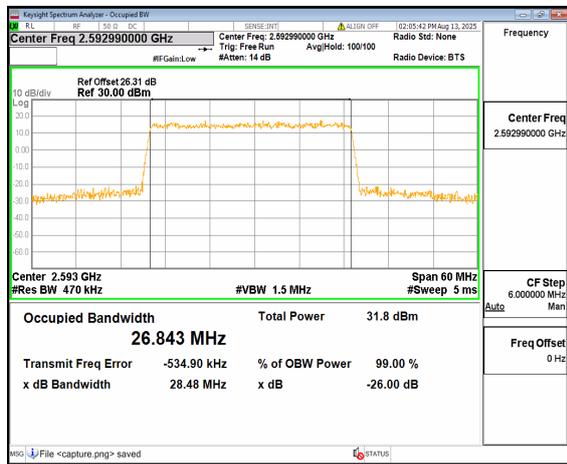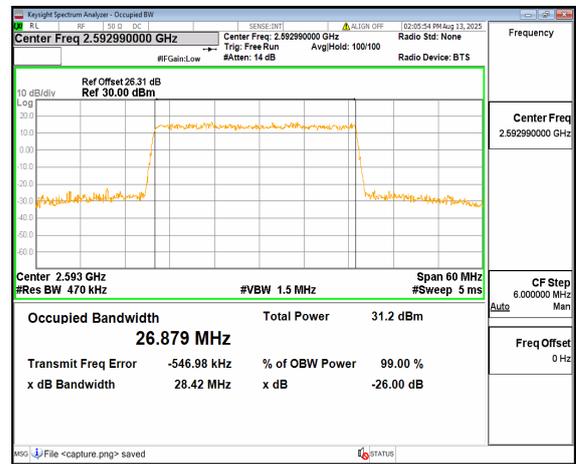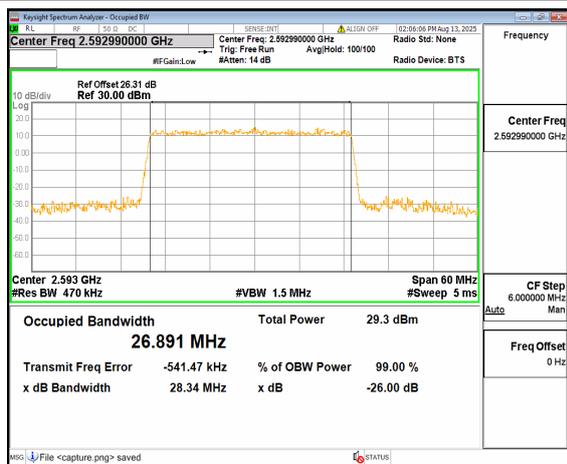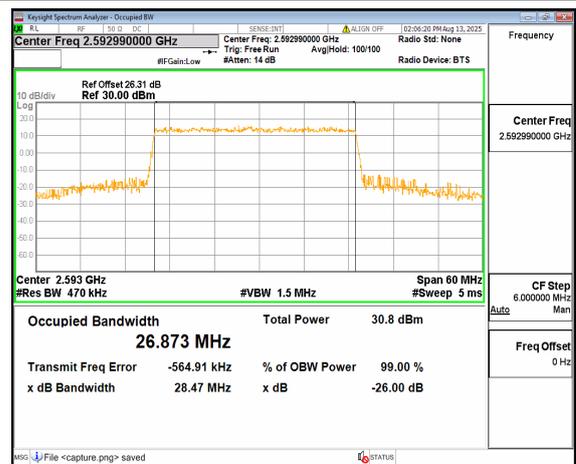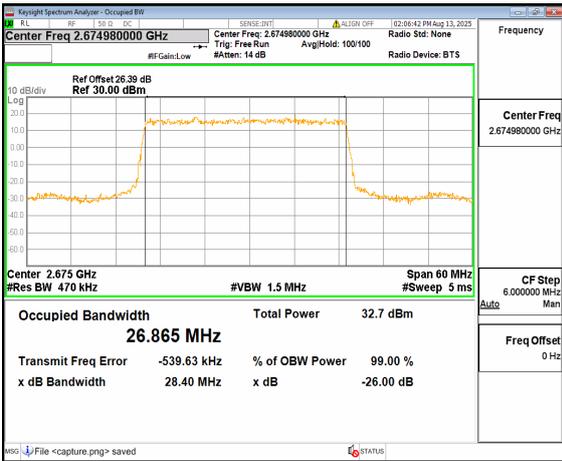n41 10M DFT-s-OFDM 256QAM Outer_Full Mid
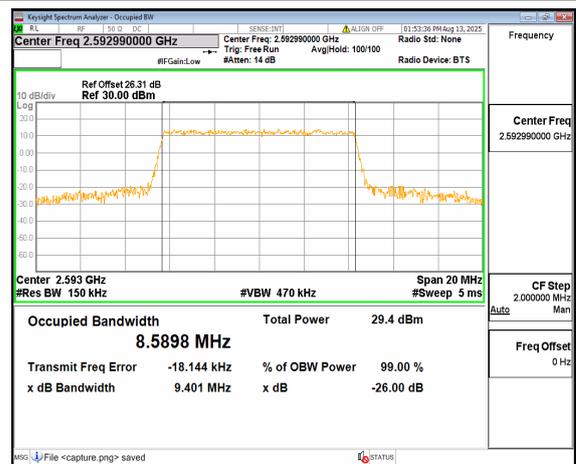


n41 10M CP-OFDM QPSK Outer_Full Mid
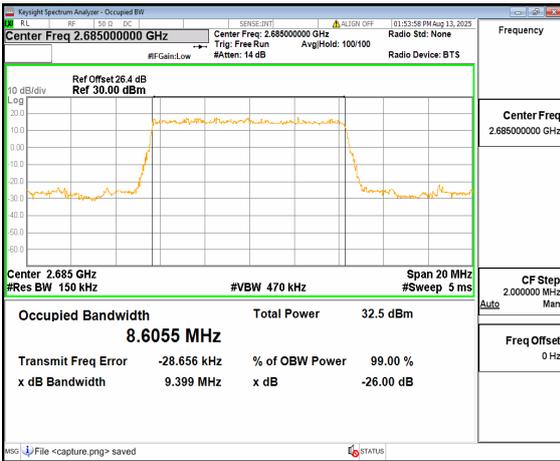
n41 10M DFT-s-OFDM BPSK Outer_Full High
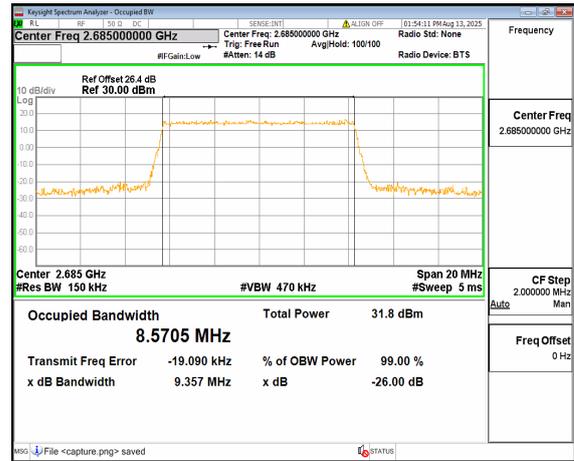


n41 10M DFT-s-OFDM QPSK Outer_Full High
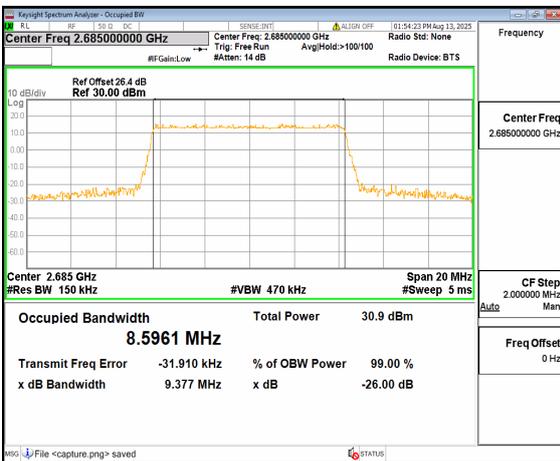


n41 10M DFT-s-OFDM 16QAM Outer_Full High
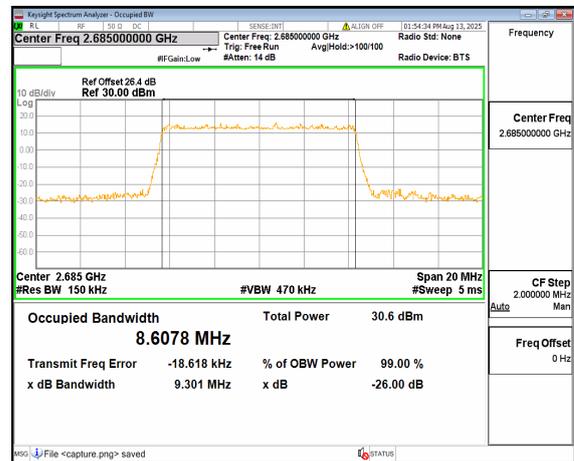


n41 10M DFT-s-OFDM 64QAM Outer_Full High
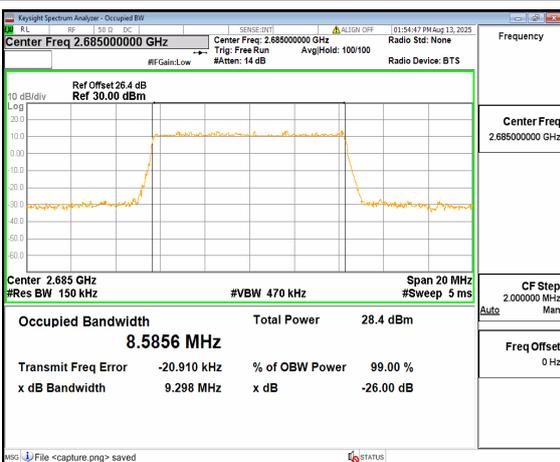


n41 10M DFT-s-OFDM 256QAM Outer_Full High



n41 10M CP-OFDM QPSK Outer_Full High

MORLAB

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page **259** of **873**
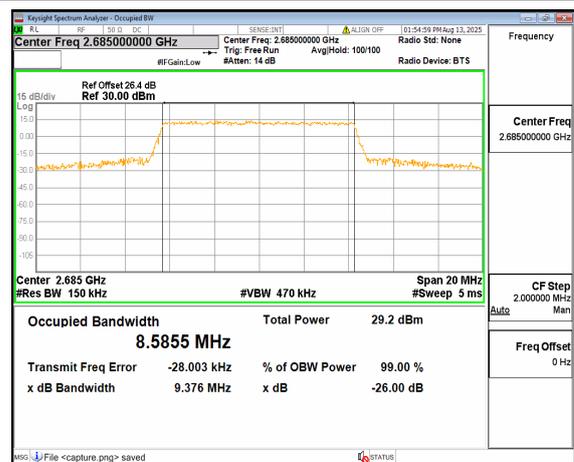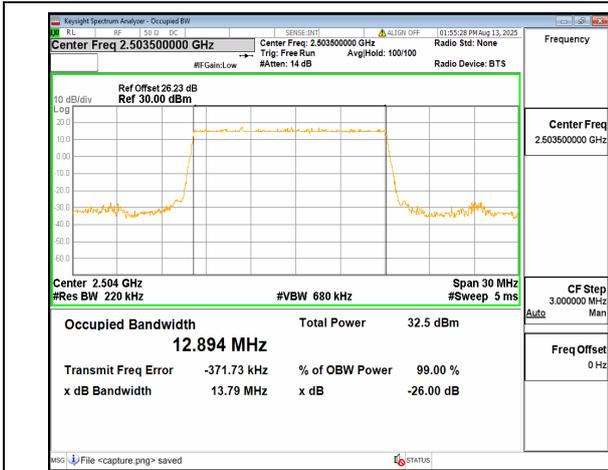
n41 15M DFT-s-OFDM BPSK Outer_Full Low
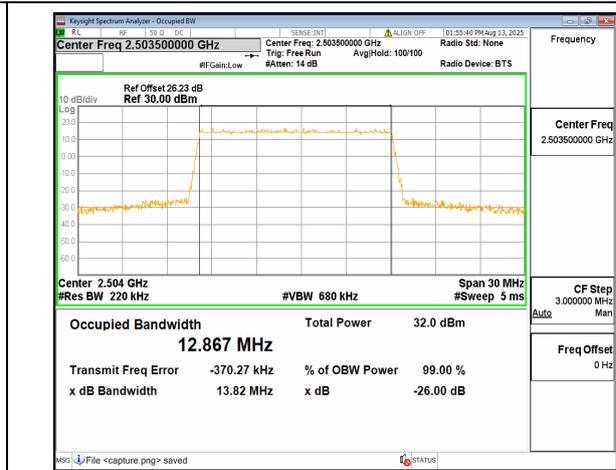


n41 15M DFT-s-OFDM QPSK Outer_Full Low
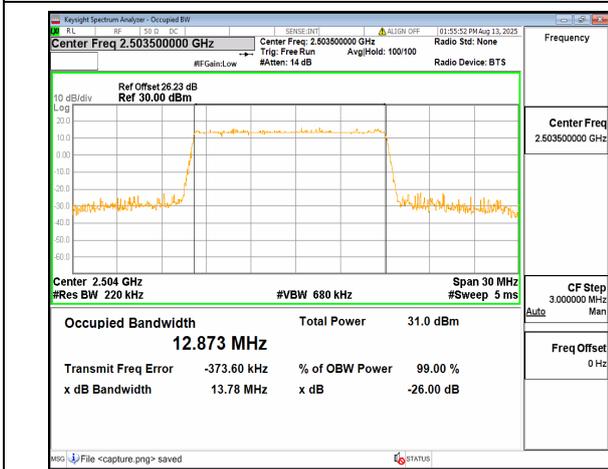


n41 15M DFT-s-OFDM 16QAM Outer_Full Low
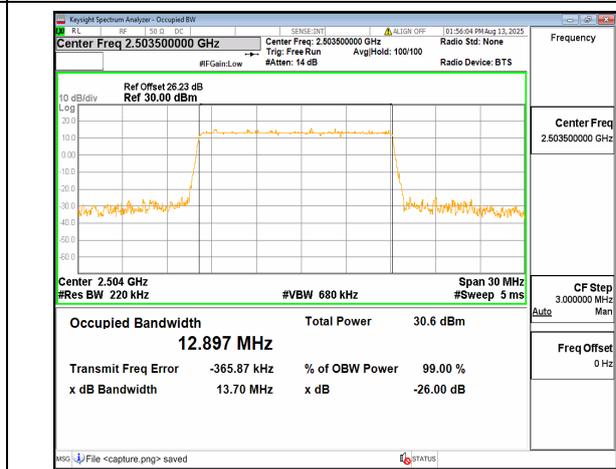


n41 15M DFT-s-OFDM 64QAM Outer_Full Low
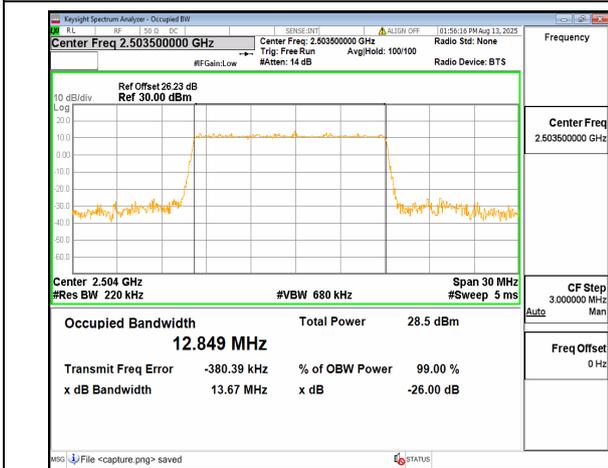


n41 15M DFT-s-OFDM 256QAM Outer_Full Low



n41 15M CP-OFDM QPSK Outer_Full Low

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page 260 of 873
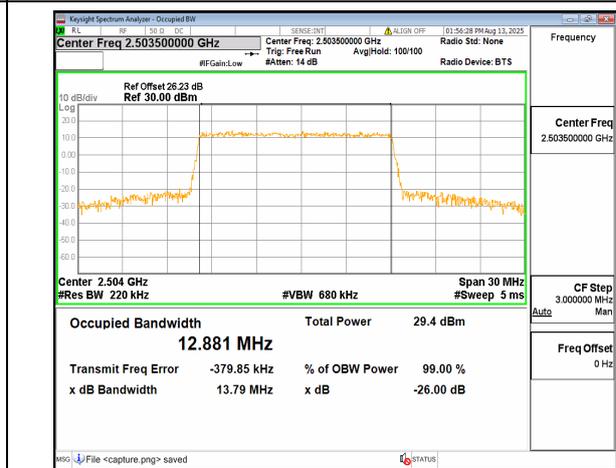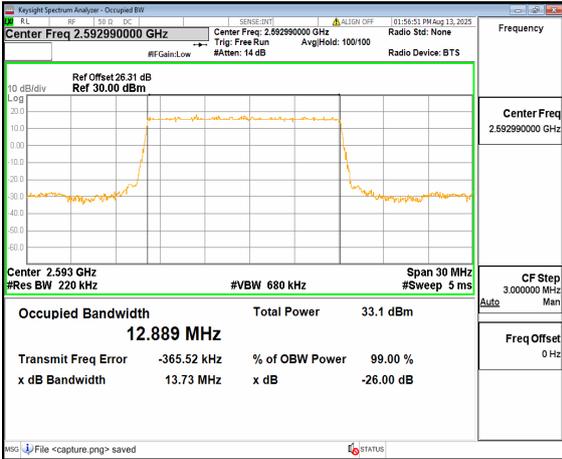
n41 15M DFT-s-OFDM BPSK Outer_Full Mid
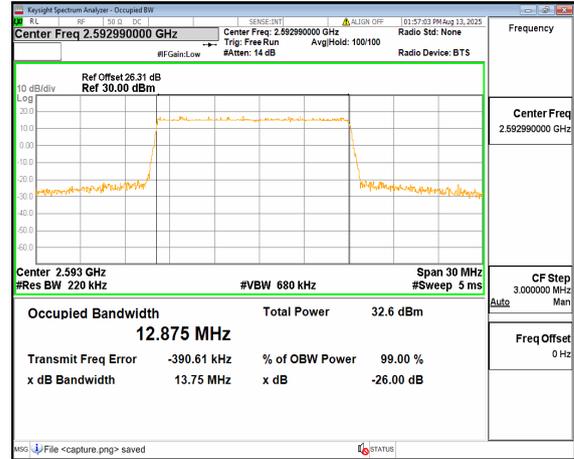


n41 15M DFT-s-OFDM QPSK Outer_Full Mid
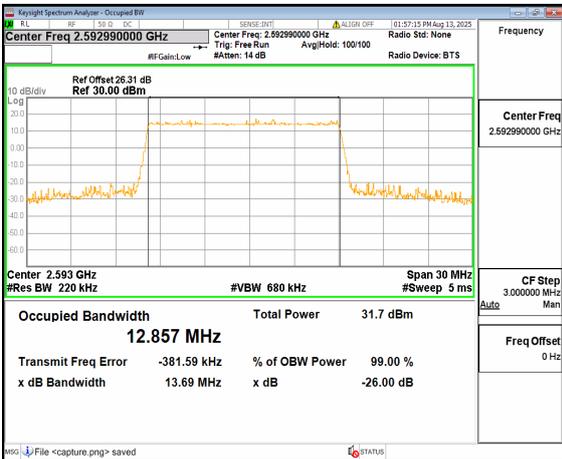


n41 15M DFT-s-OFDM 16QAM Outer_Full Mid
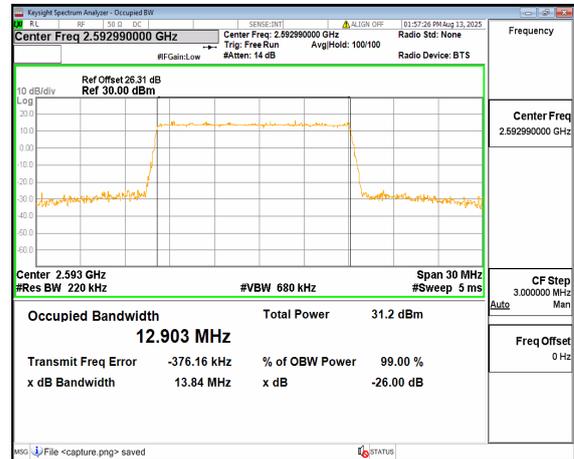


n41 15M DFT-s-OFDM 64QAM Outer_Full Mid
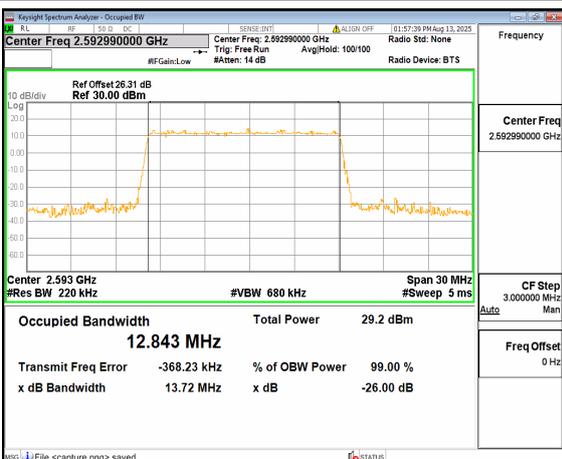


n41 15M DFT-s-OFDM 256QAM Outer_Full Mid



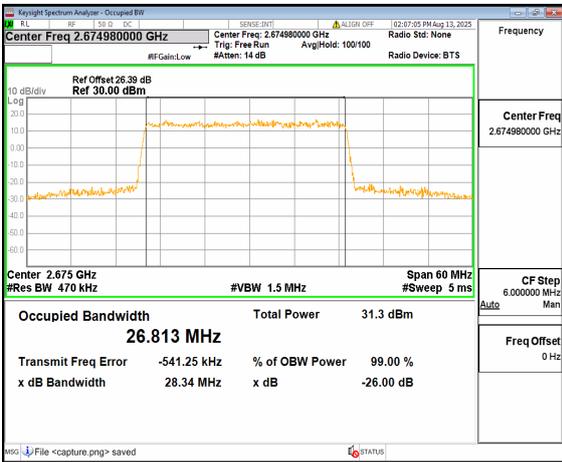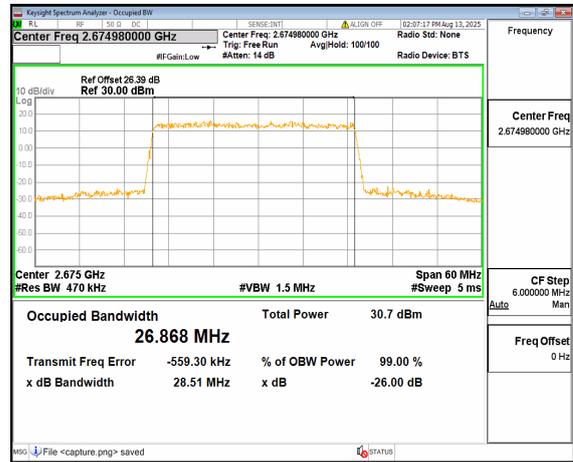n41 15M CP-OFDM QPSK Outer_Full Mid

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555   Fax: 86-755-36698525

Http://www.morlab.cn   E-mail: service@morlab.cn

Page 261 of 873
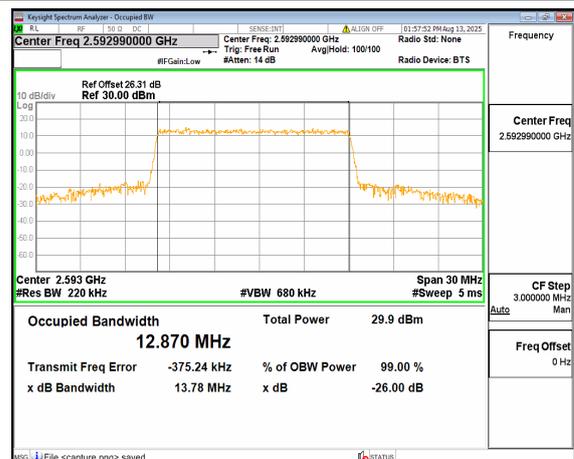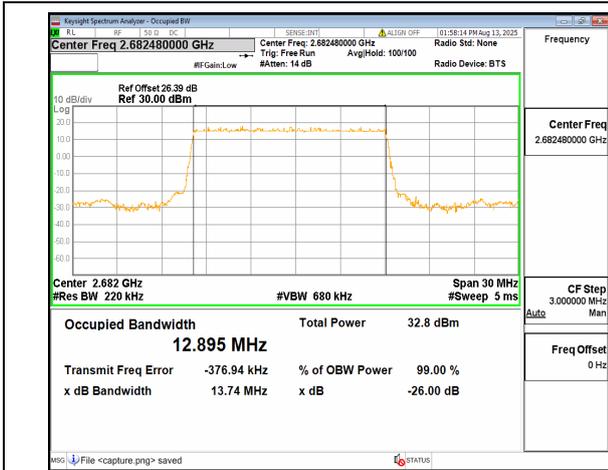
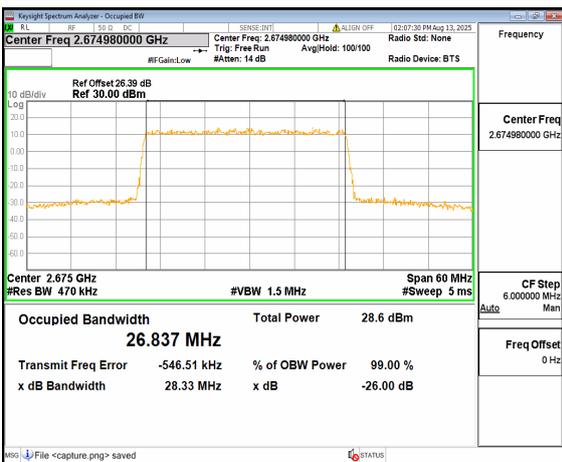n41 15M DFT-s-OFDM BPSK Outer_Full High
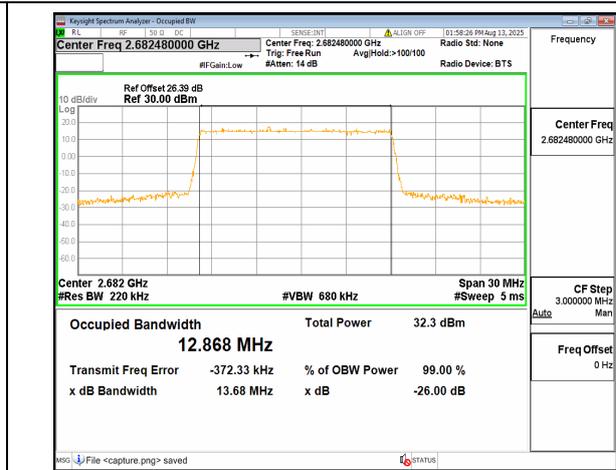


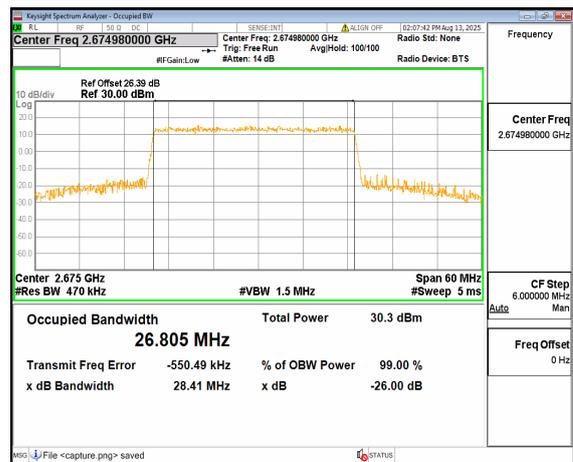n41 15M DFT-s-OFDM QPSK Outer_Full High
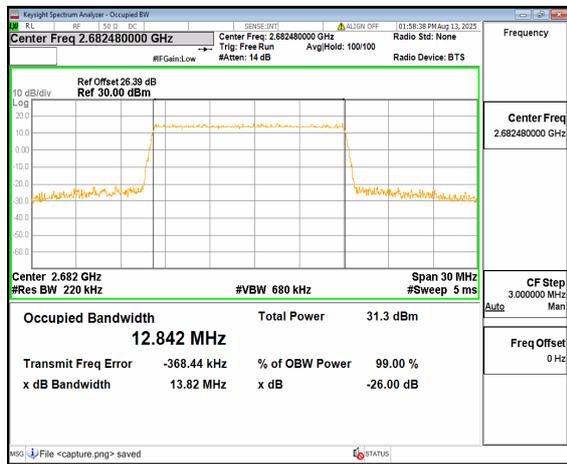


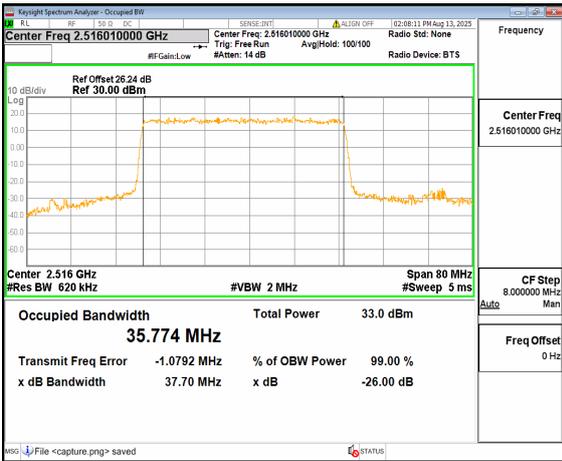n41 15M DFT-s-OFDM 16QAM Outer_Full High
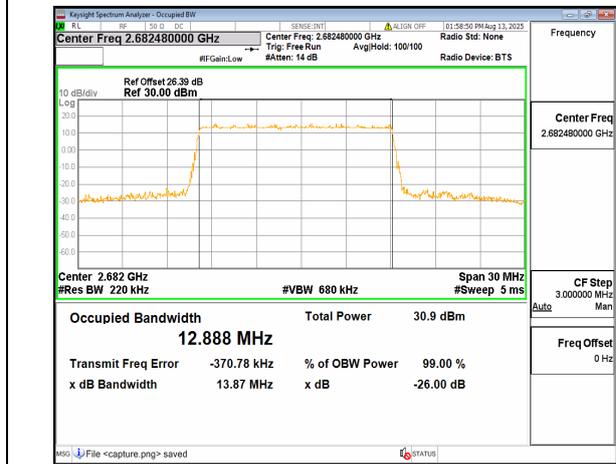


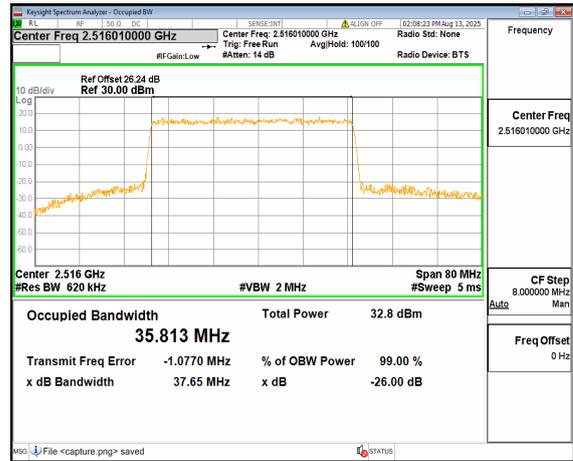n41 15M DFT-s-OFDM 64QAM Outer_Full High
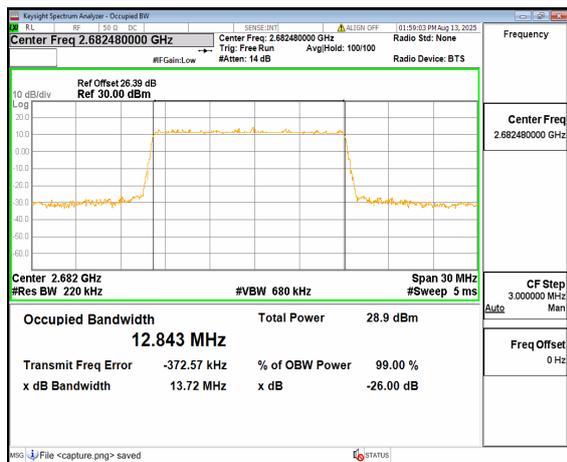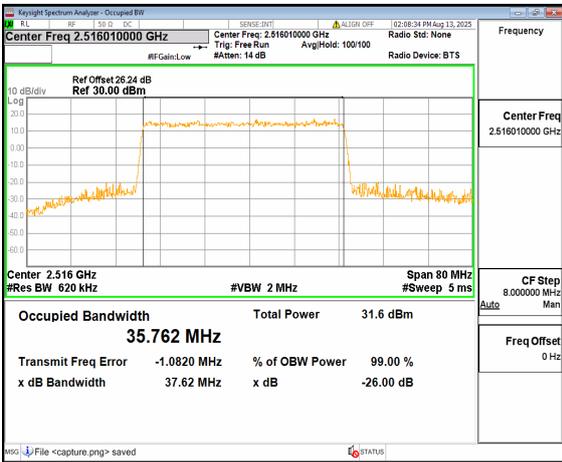


n41 15M DFT-s-OFDM 256QAM Outer_Full High
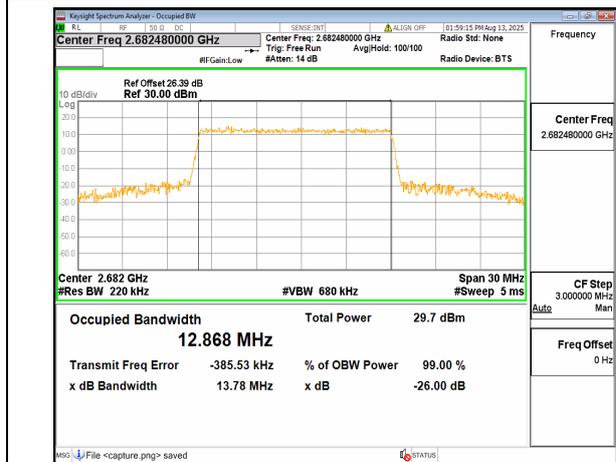

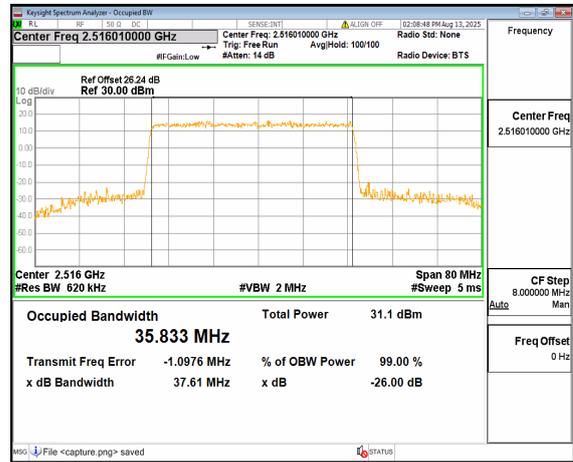
n41 15M CP-OFDM QPSK Outer_Full High
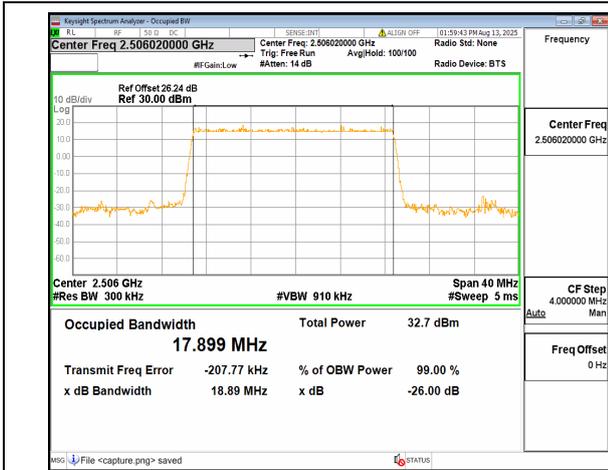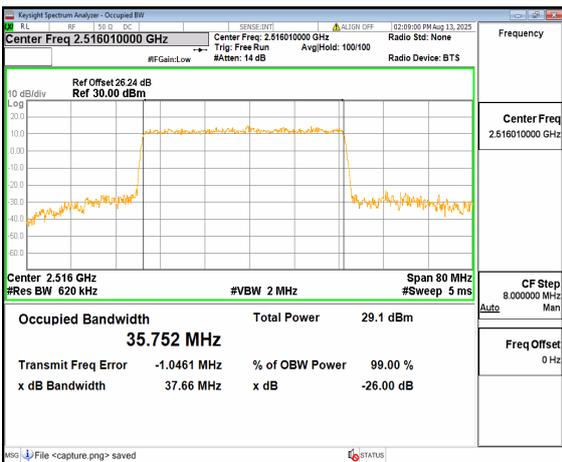
n41 20M DFT-s-OFDM BPSK Outer_Full Low
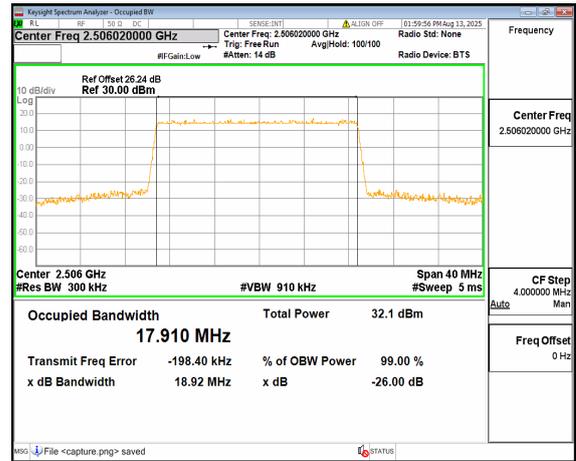


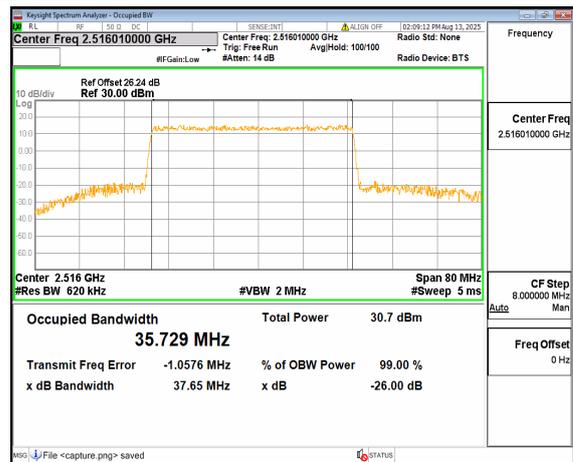n41 20M DFT-s-OFDM QPSK Outer_Full Low
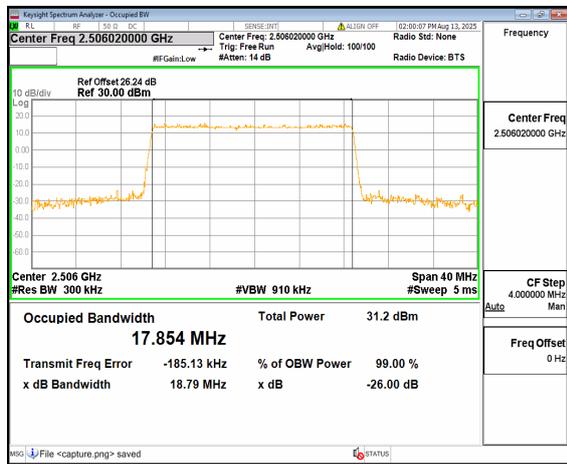


n41 20M DFT-s-OFDM 16QAM Outer_Full Low
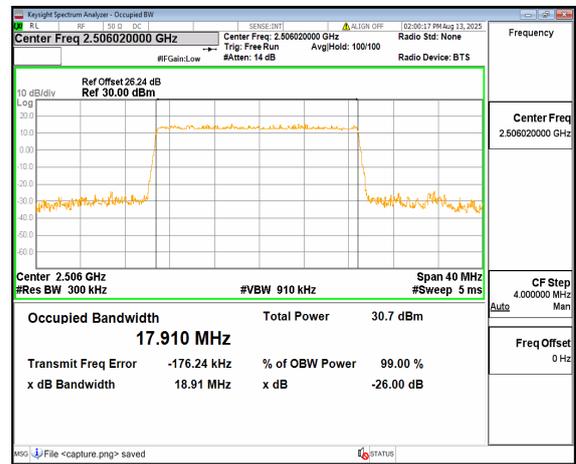


n41 20M DFT-s-OFDM 64QAM Outer_Full Low
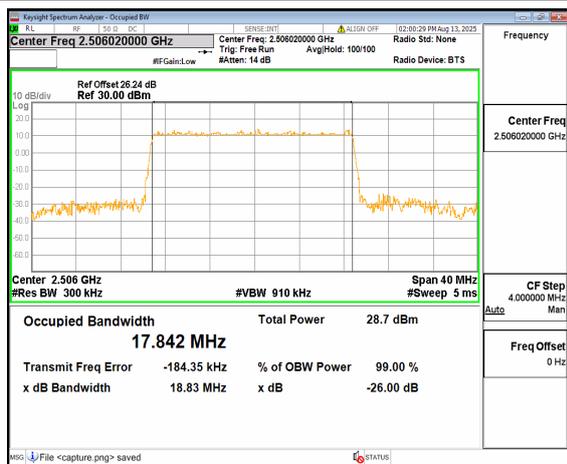


n41 20M DFT-s-OFDM 256QAM Outer_Full Low



n41 20M CP-OFDM QPSK Outer_Full Low

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road, Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555      Fax: 86-755-36698525

Http://www.morlab.cn      E-mail: service@morlab.cn

Page 263 of 873
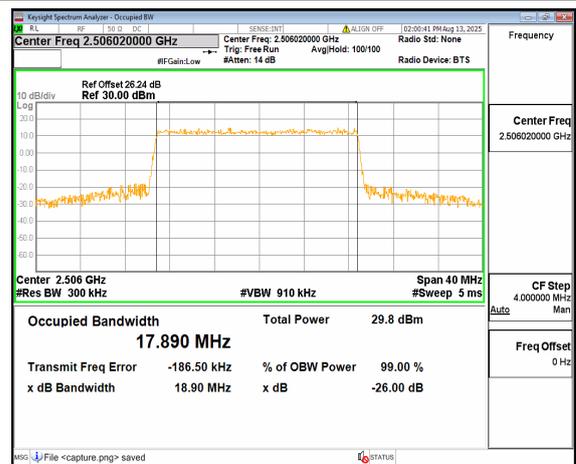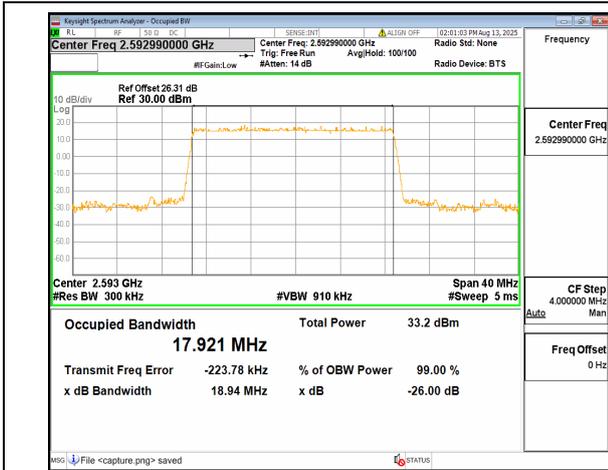
n41 20M DFT-s-OFDM BPSK Outer_Full Mid
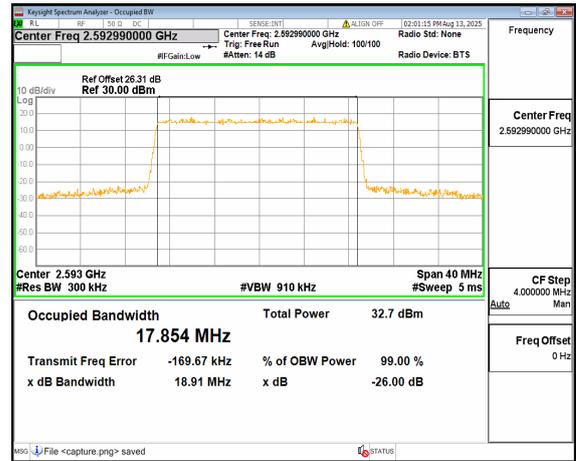


n41 20M DFT-s-OFDM QPSK Outer_Full Mid
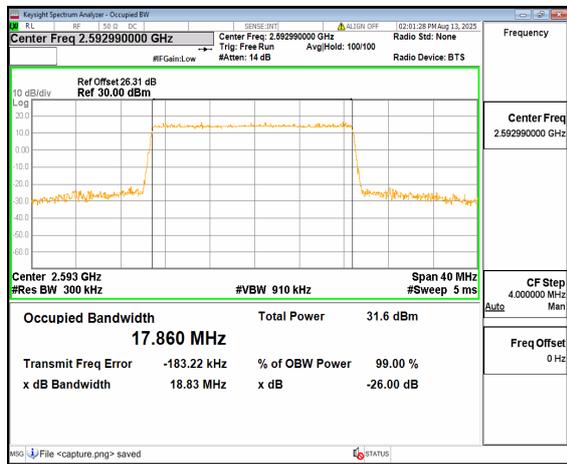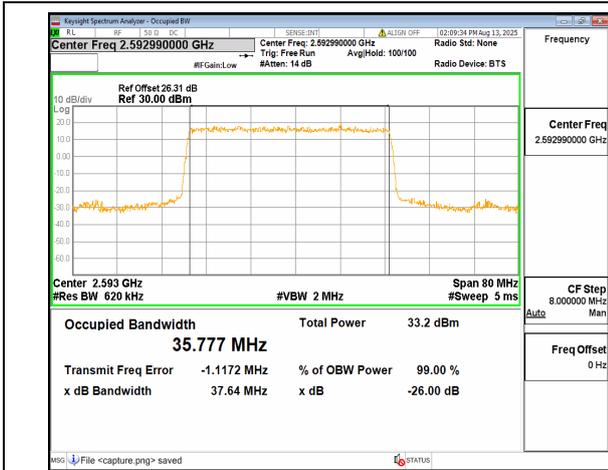


n41 20M DFT-s-OFDM 16QAM Outer_Full Mid
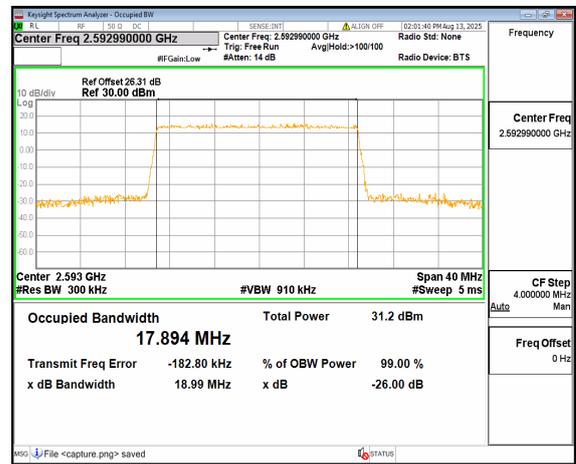


n41 20M DFT-s-OFDM 64QAM Outer_Full Mid
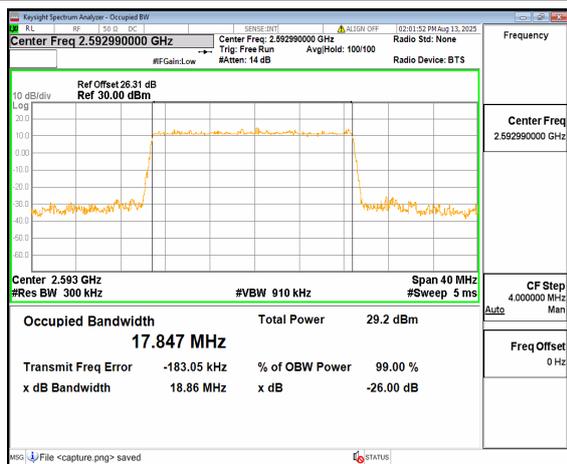


n41 20M DFT-s-OFDM 256QAM Outer_Full Mid



n41 20M CP-OFDM QPSK Outer_Full Mid

MORLAB

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555      Fax: 86-755-36698525

Http://www.morlab.cn        E-mail: service@morlab.cn

Page **264** of 873

n41 20M DFT-s-OFDM BPSK Outer_Full High



n41 20M DFT-s-OFDM QPSK Outer_Full High



n41 20M DFT-s-OFDM 16QAM Outer_Full High



n41 20M DFT-s-OFDM 64QAM Outer_Full High



n41 20M DFT-s-OFDM 256QAM Outer_Full High



n41 20M CP-OFDM QPSK Outer_Full High

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555      Fax: 86-755-36698525

Http://www.morlab.cn      E-mail: service@morlab.cn

Page 265 of 873

n41 30M DFT-s-OFDM BPSK Outer_Full Low



n41 30M DFT-s-OFDM QPSK Outer_Full Low



n41 30M DFT-s-OFDM 16QAM Outer_Full Low



n41 30M DFT-s-OFDM 64QAM Outer_Full Low



n41 30M DFT-s-OFDM 256QAM Outer_Full Low


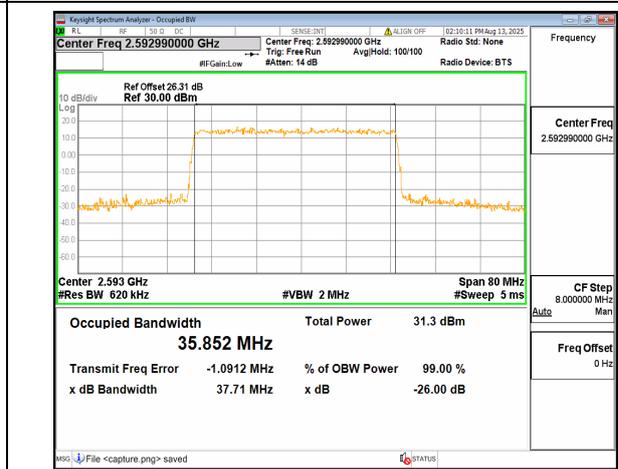
n41 30M CP-OFDM QPSK Outer_Full Low
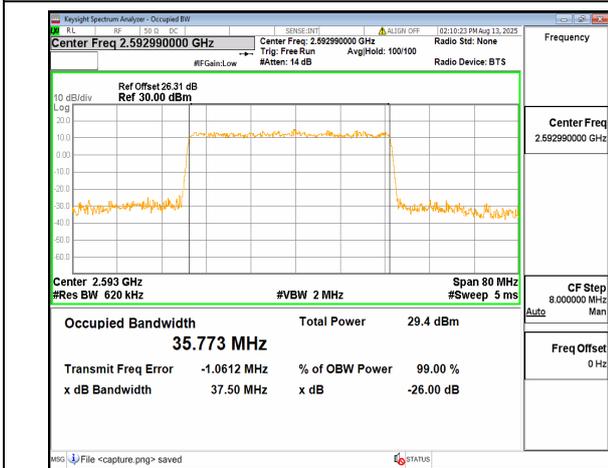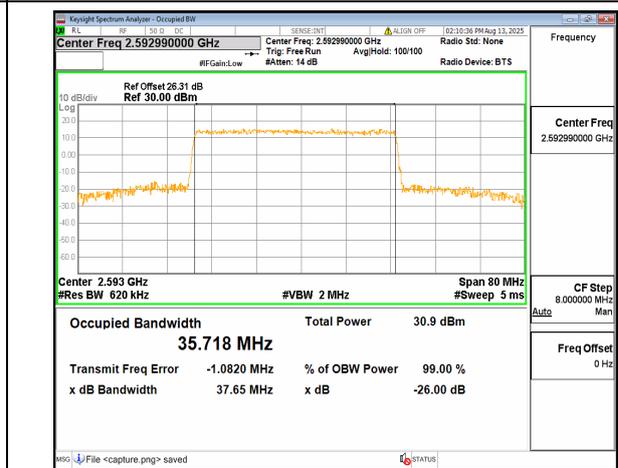
n41 30M DFT-s-OFDM BPSK Outer_Full Mid



n41 30M DFT-s-OFDM QPSK Outer_Full Mid



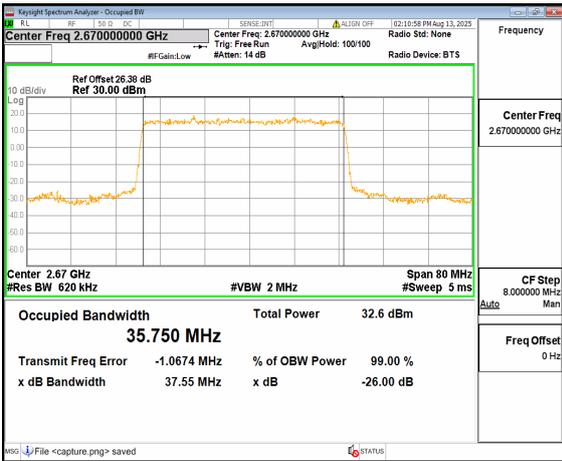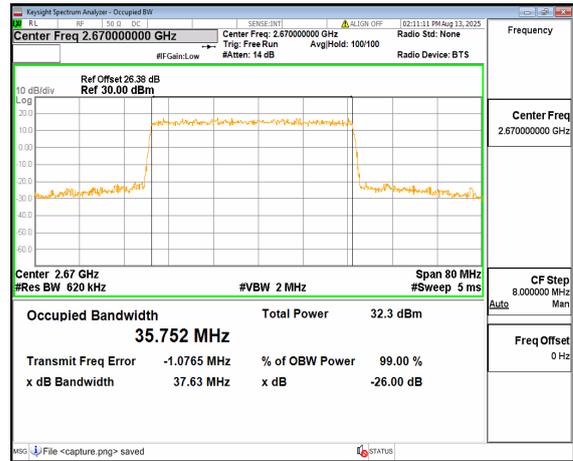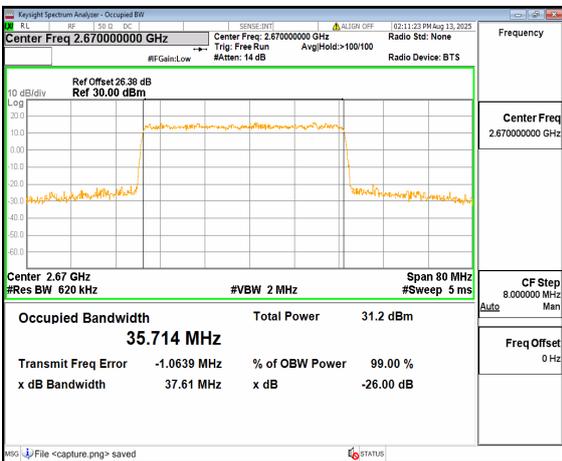n41 30M DFT-s-OFDM 16QAM Outer_Full Mid



n41 30M DFT-s-OFDM 64QAM Outer_Full Mid



n41 30M DFT-s-OFDM 256QAM Outer_Full Mid



n41 30M CP-OFDM QPSK Outer_Full Mid

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

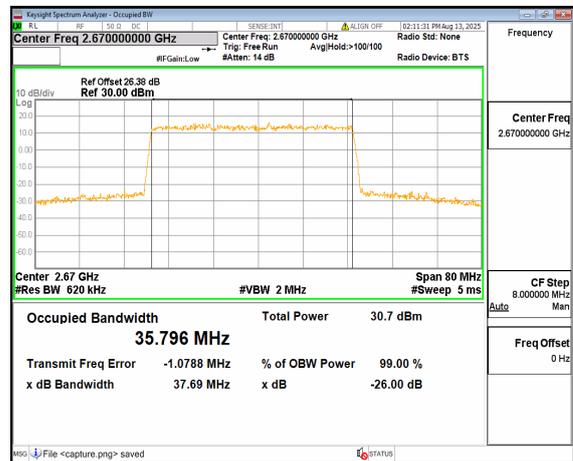Http://www.morlab.cn    E-mail: service@morlab.cn

Page 267 of 873

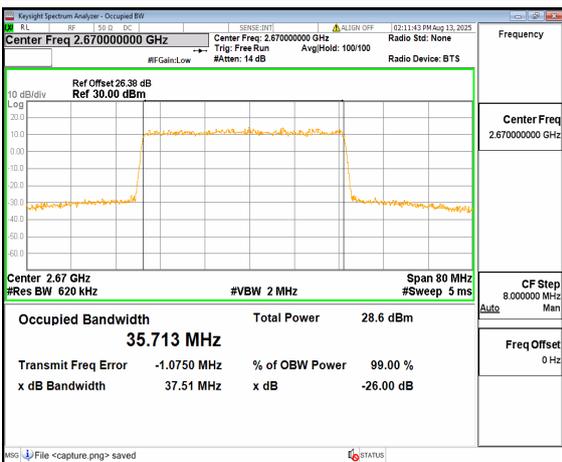n41 30M DFT-s-OFDM BPSK Outer_Full High
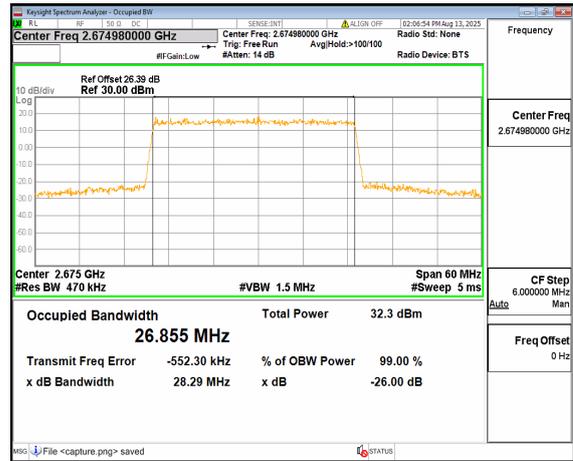


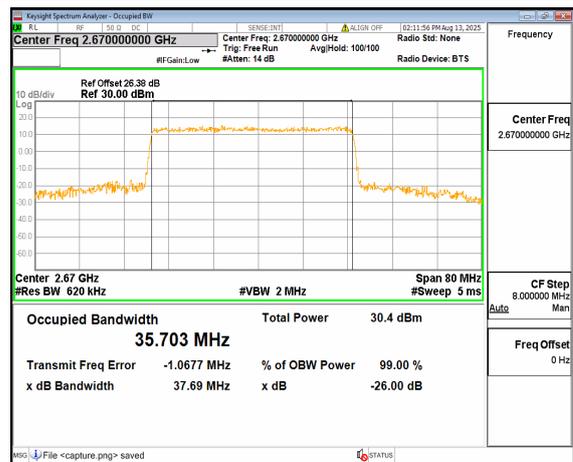n41 30M DFT-s-OFDM QPSK Outer_Full High
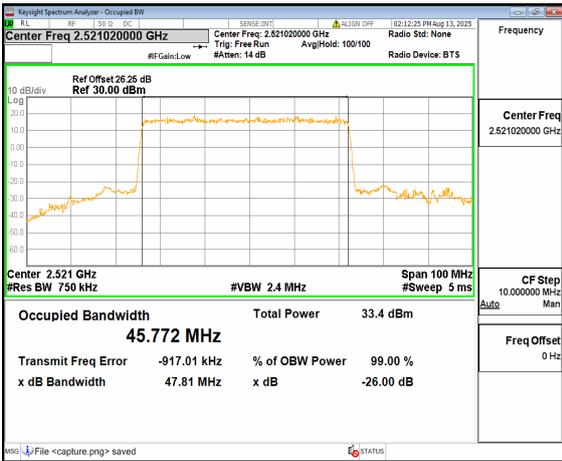


n41 30M DFT-s-OFDM 16QAM Outer_Full High

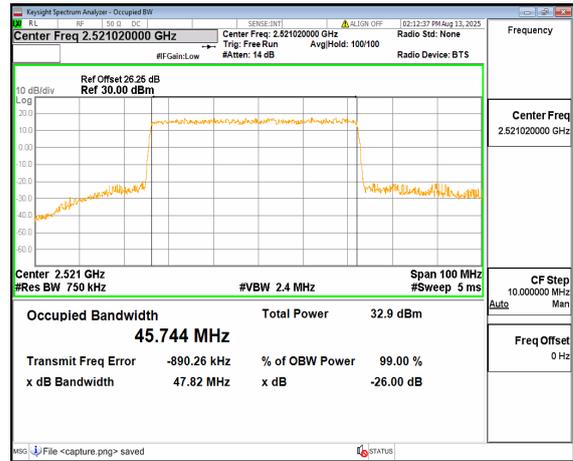

n41 30M DFT-s-OFDM 64QAM Outer_Full High



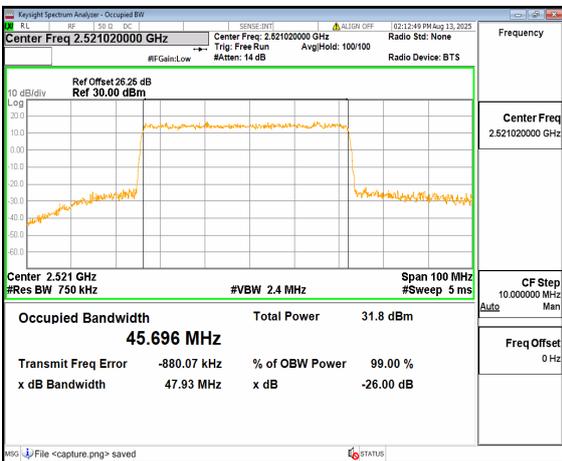n41 30M DFT-s-OFDM 256QAM Outer_Full High


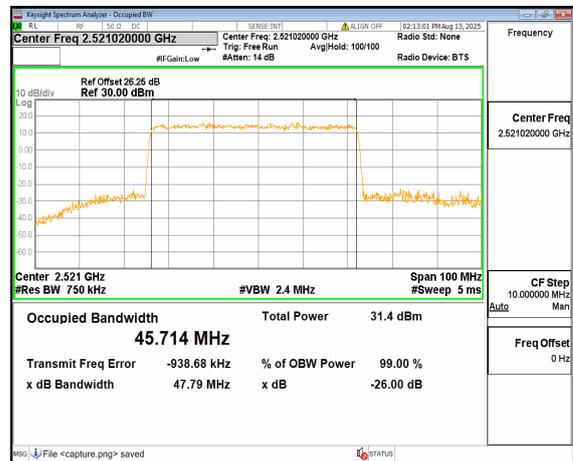
n41 30M CP-OFDM QPSK Outer_Full High

n41 40M DFT-s-OFDM BPSK Outer_Full Low



n41 40M DFT-s-OFDM QPSK Outer_Full Low



n41 40M DFT-s-OFDM 16QAM Outer_Full Low



n41 40M DFT-s-OFDM 64QAM Outer_Full Low



n41 40M DFT-s-OFDM 256QAM Outer_Full Low



n41 40M CP-OFDM QPSK Outer_Full Low

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555     Fax: 86-755-36698525

Http://www.morlab.cn     E-mail: service@morlab.cn

Page 269 of 873

n41 40M DFT-s-OFDM BPSK Outer_Full Mid
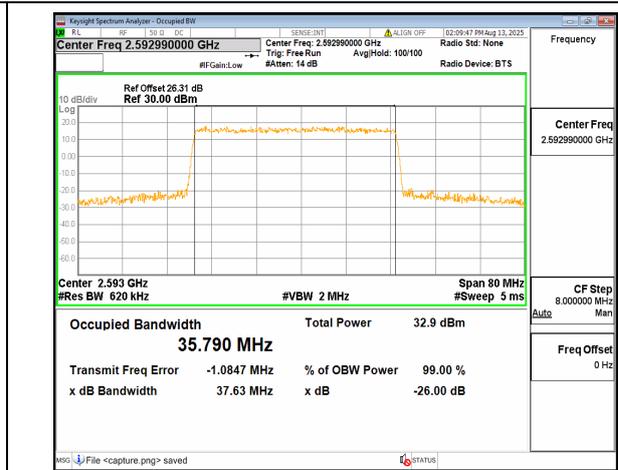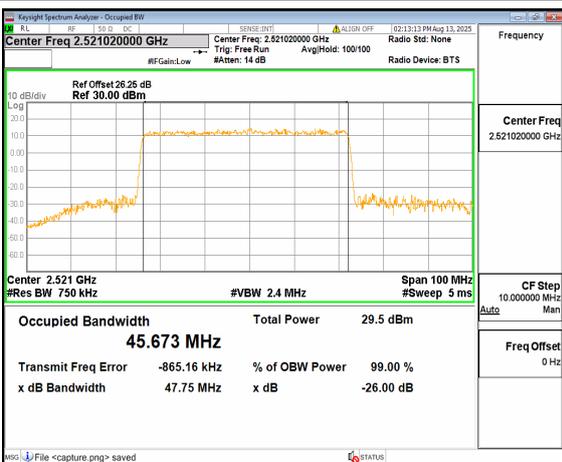


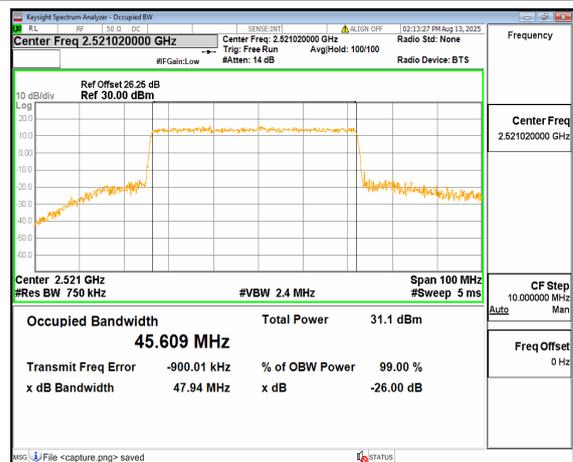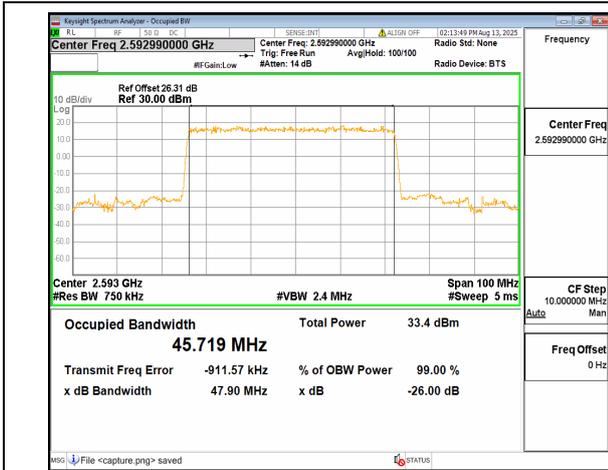n41 40M DFT-s-OFDM QPSK Outer_Full Mid
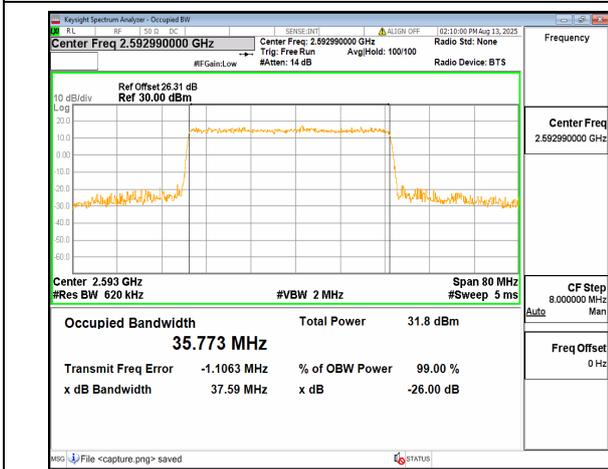


n41 40M DFT-s-OFDM 16QAM Outer_Full Mid



n41 40M DFT-s-OFDM 64QAM Outer_Full Mid



n41 40M DFT-s-OFDM 256QAM Outer_Full Mid



n41 40M CP-OFDM QPSK Outer_Full Mid

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road, Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555    Fax: 86-755-36698525

Http://www.morlab.cn    E-mail: service@morlab.cn

Page 270 of 873

n41 40M DFT-s-OFDM BPSK Outer_Full High



n41 40M DFT-s-OFDM QPSK Outer_Full High



n41 40M DFT-s-OFDM 16QAM Outer_Full High



n41 40M DFT-s-OFDM 64QAM Outer_Full High



n41 40M DFT-s-OFDM 256QAM Outer_Full High



n41 40M CP-OFDM QPSK Outer_Full High

MORLAB

Shenzhen Morlab Communication Technology Co., Ltd.
FL.1-3, Building A, FeiYang Science Park, No.8 LongChang Road,
Block67, BaoAn District, ShenZhen , GuangDong Province, P. R. China

Tel: 86-755-36698555     Fax: 86-755-36698525

Http://www.morlab.cn     E-mail: service@morlab.cn

Page 271 of 873

n41 50M DFT-s-OFDM BPSK Outer_Full Low



n41 50M DFT-s-OFDM QPSK Outer_Full Low



n41 50M DFT-s-OFDM 16QAM Outer_Full Low



n41 50M DFT-s-OFDM 64QAM Outer_Full Low



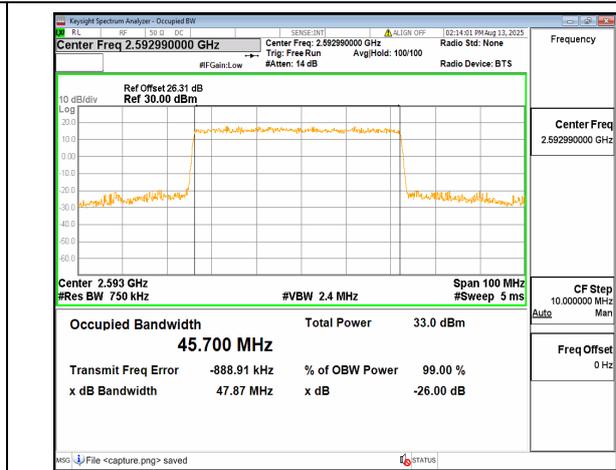n41 50M DFT-s-OFDM 256QAM Outer_Full Low
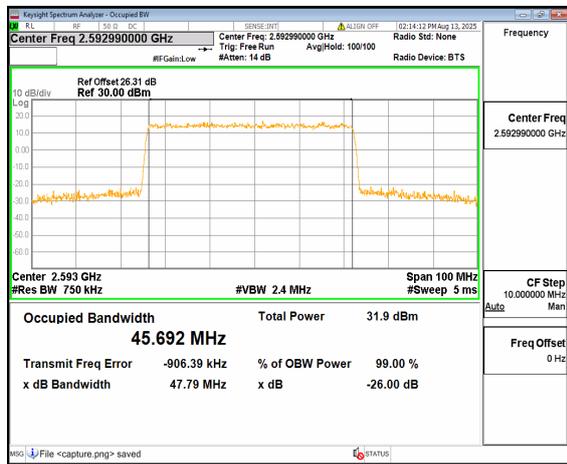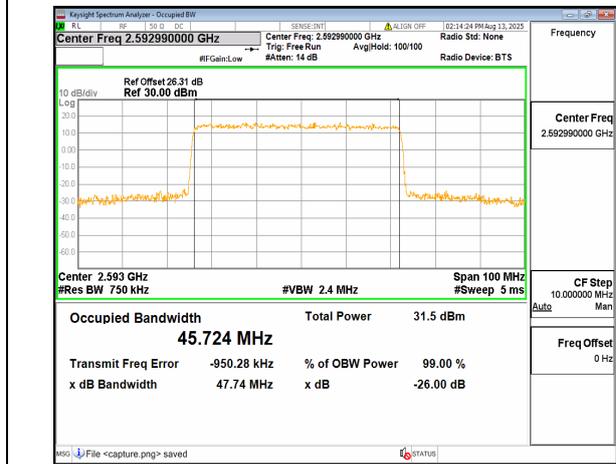


n41 50M CP-OFDM QPSK Outer_Full Low

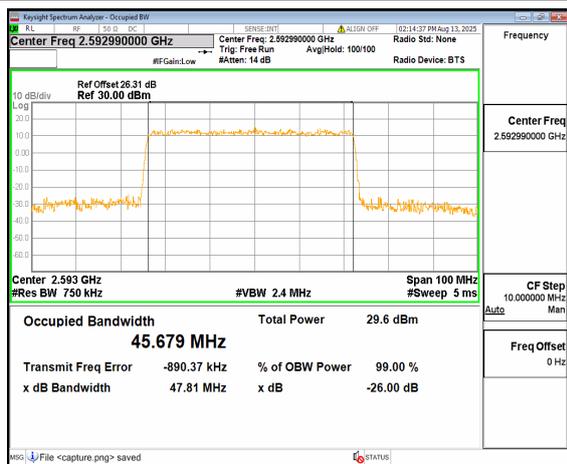n41 50M DFT-s-OFDM BPSK Outer_Full Mid

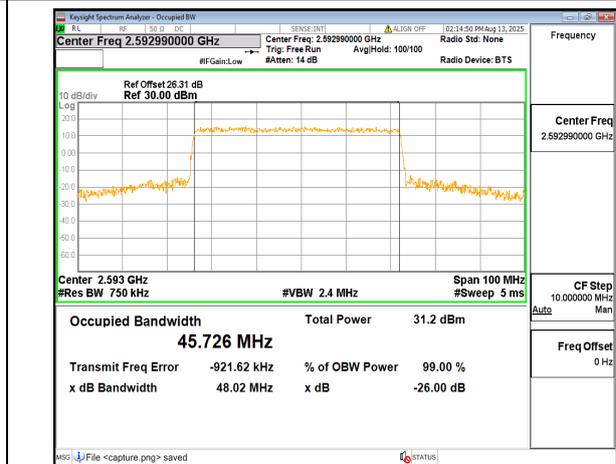

n41 50M DFT-s-OFDM QPSK Outer_Full Mid



n41 50M DFT-s-OFDM 16QAM Outer_Full Mid



n41 50M DFT-s-OFDM 64QAM Outer_Full Mid



n41 50M DFT-s-OFDM 256QAM Outer_Full Mid



n41 50M CP-OFDM QPSK Outer_Full Mid