




Tx. Spurious n20 5240MHz Ant2

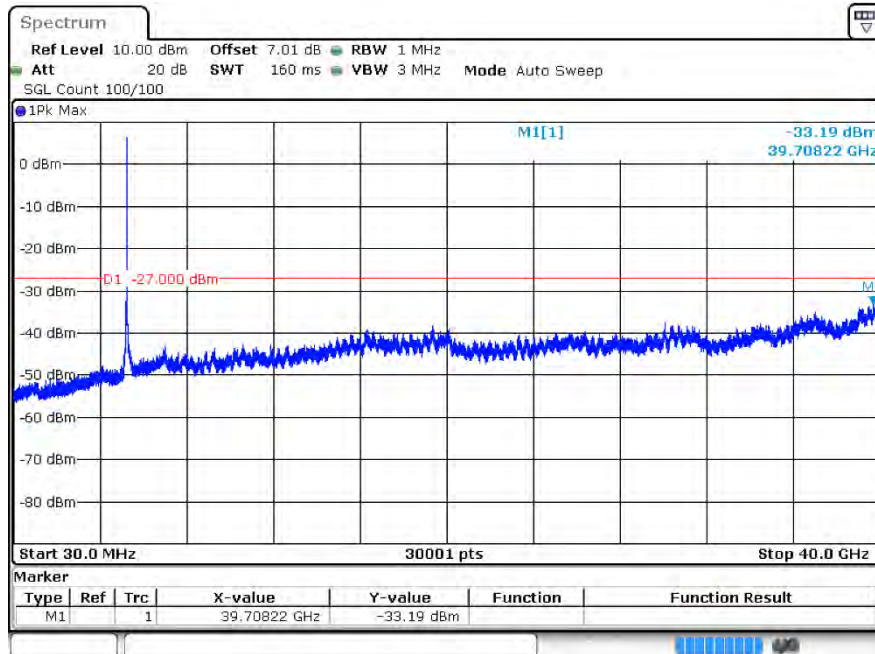


Tx. Spurious n20 5260MHz Ant2

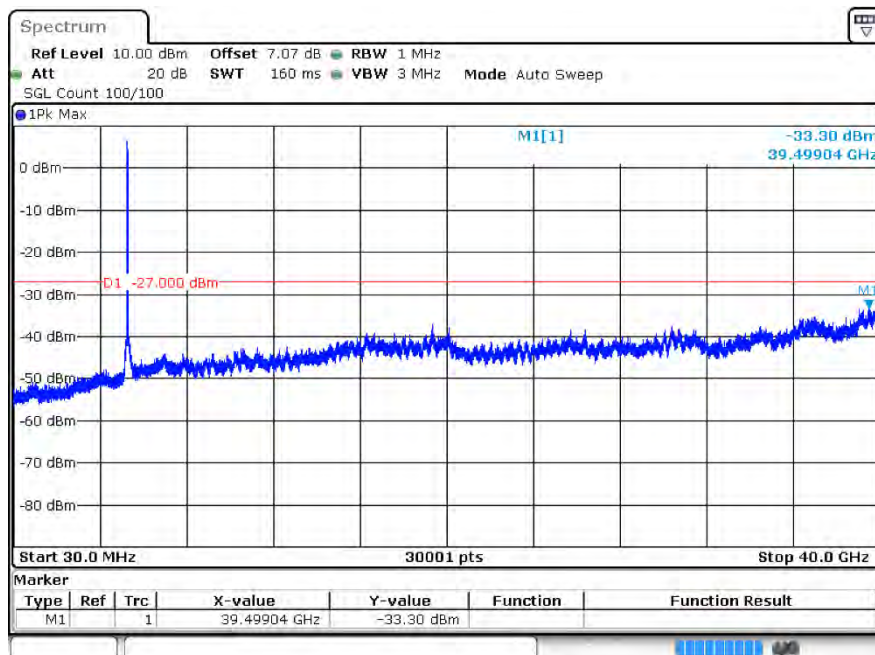


Tx. Spurious n20 5280MHz Ant2

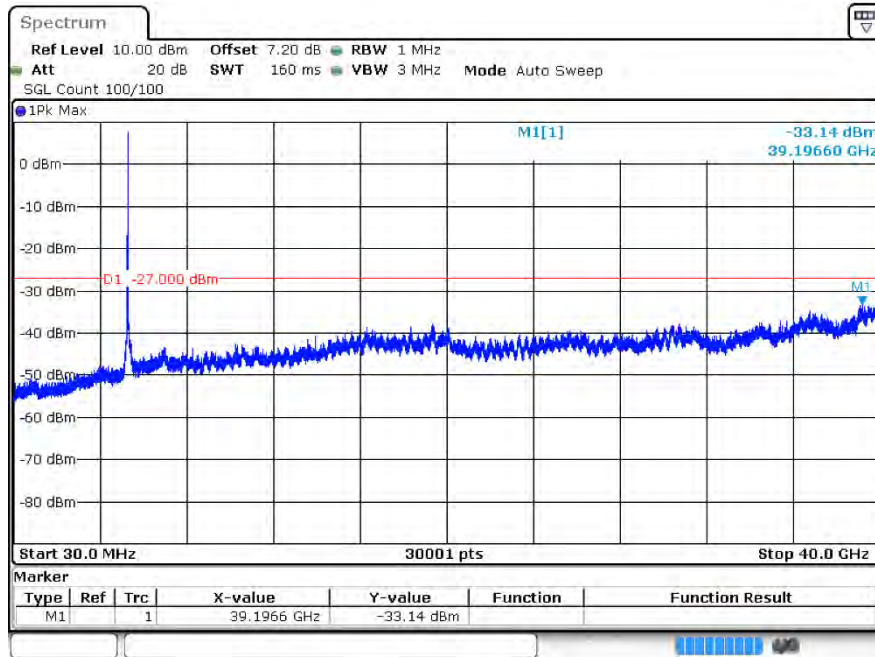


Tx. Spurious n20 5320MHz Ant2

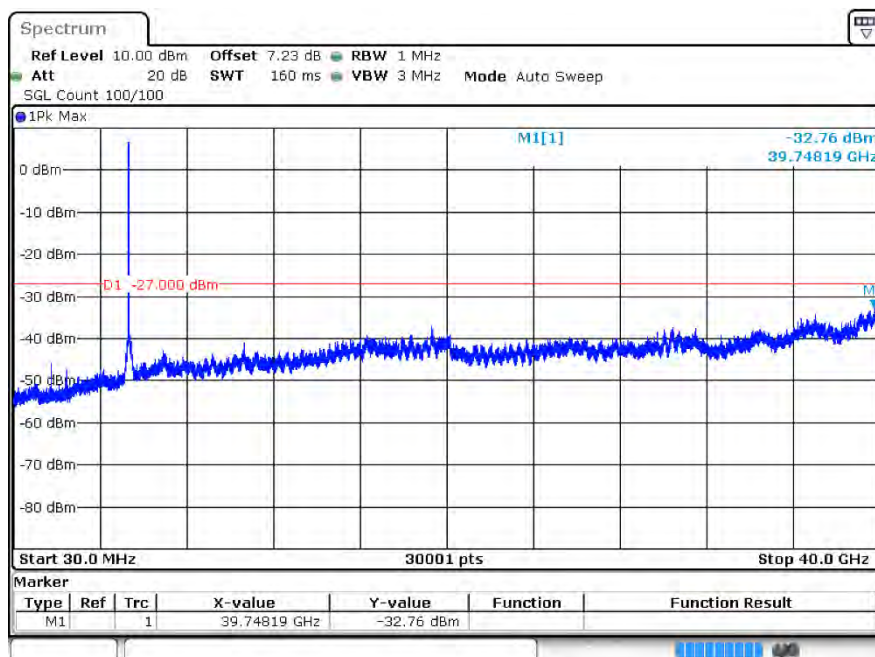


Tx. Spurious n20 5500MHz Ant2

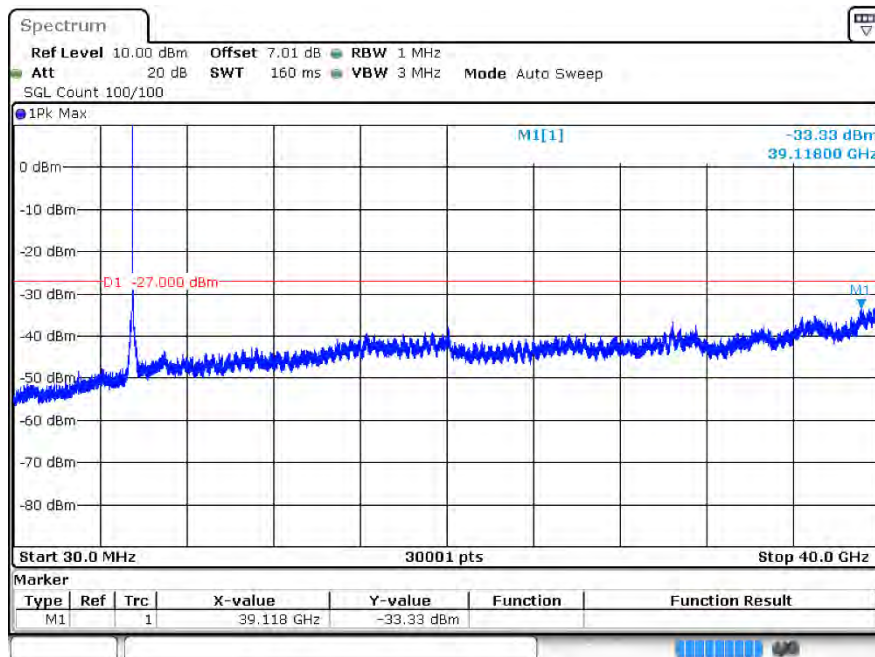


Tx. Spurious n20 5600MHz Ant2

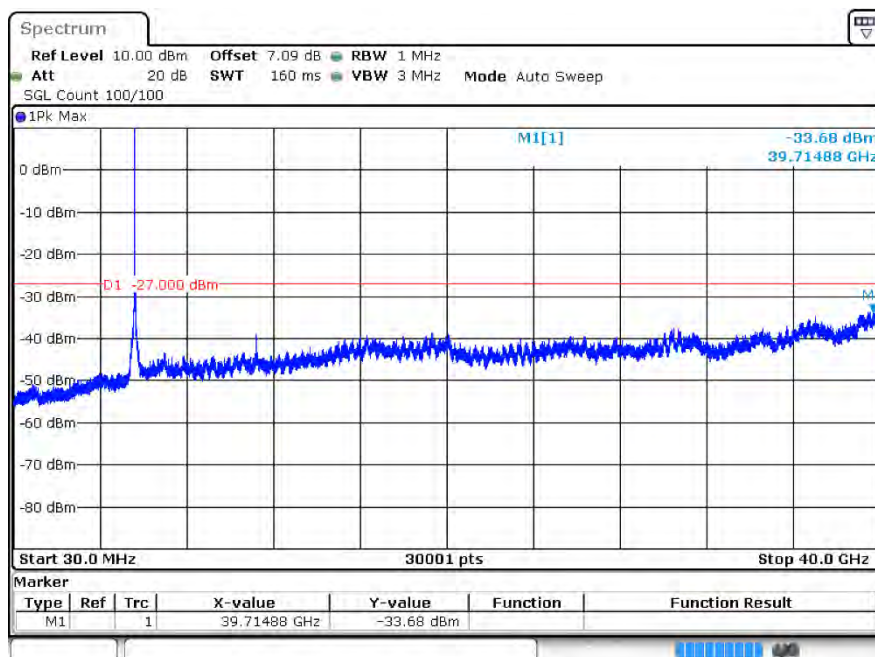

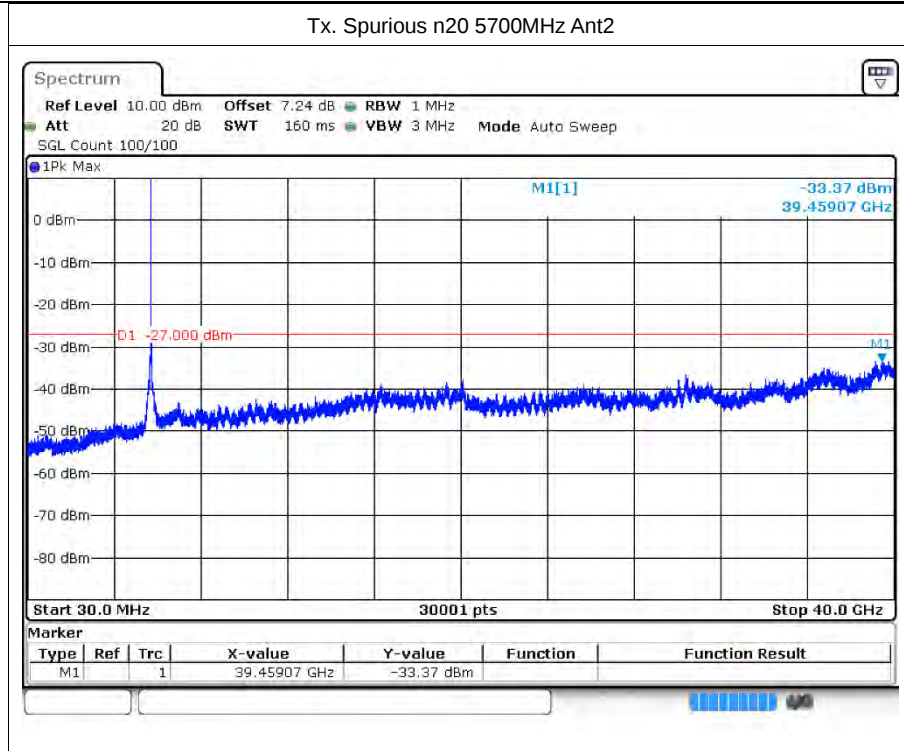





Tx. Spuriousn40 5190MHz Ant2

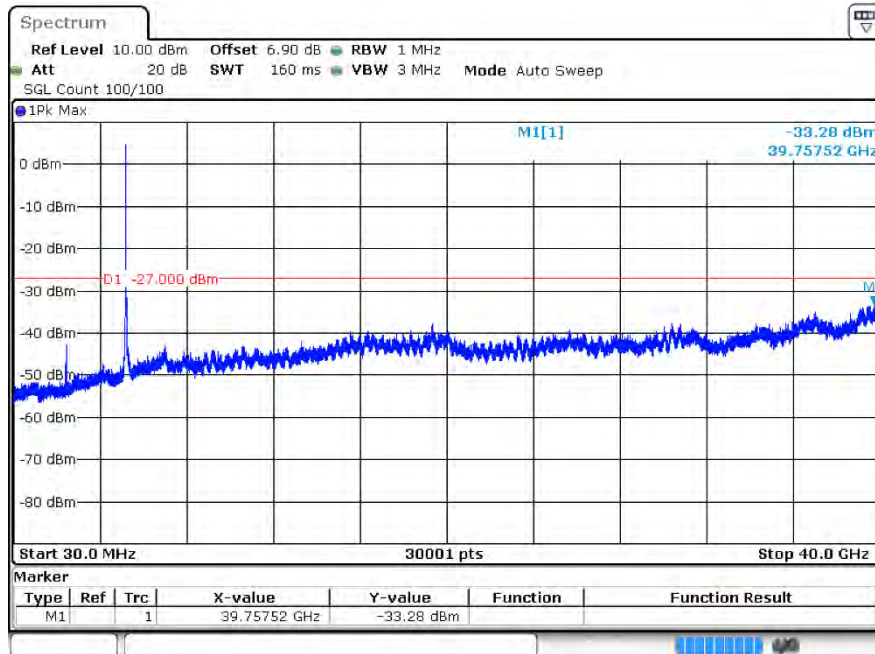


Tx. Spuriousn40 5230MHz Ant2

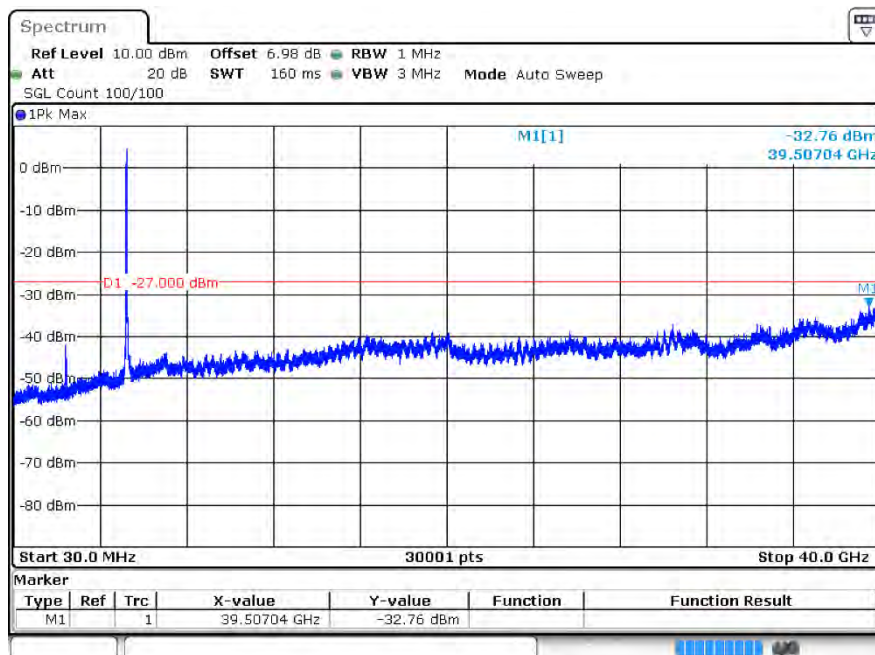


Tx. Spurious n40 5270MHz Ant2

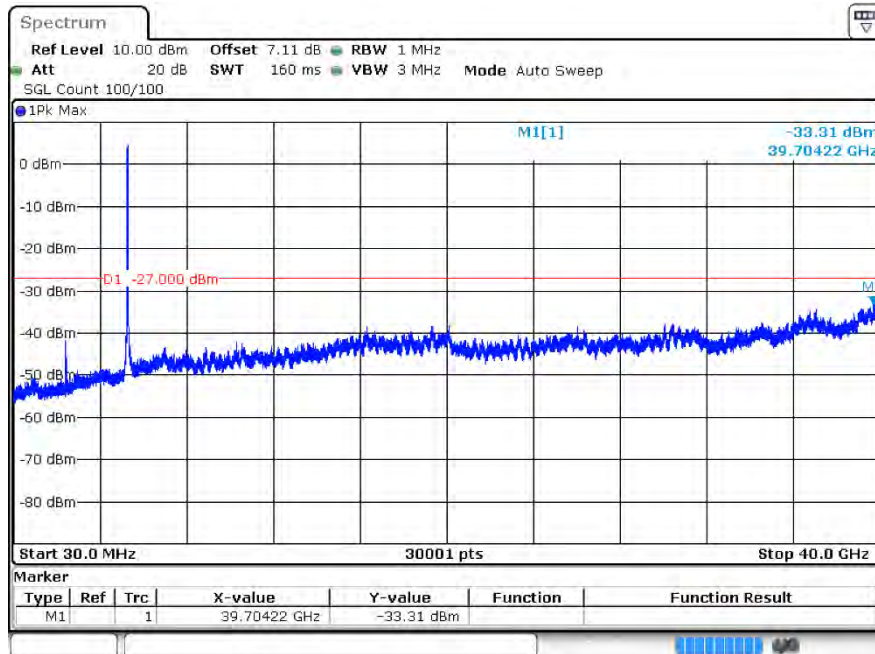


Tx. Spurious n40 5310MHz Ant2

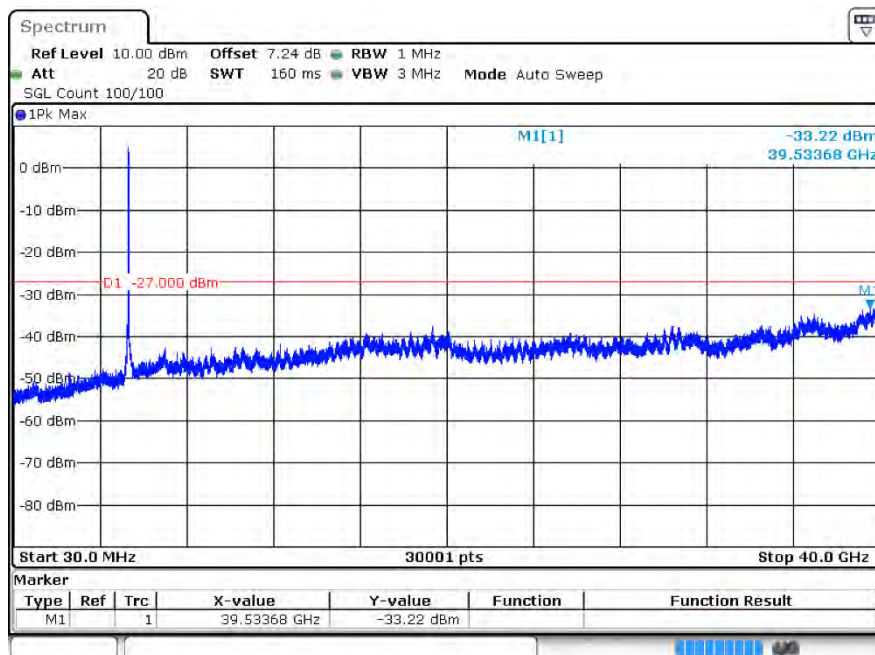


Tx. Spuriousn40 5510MHz Ant2

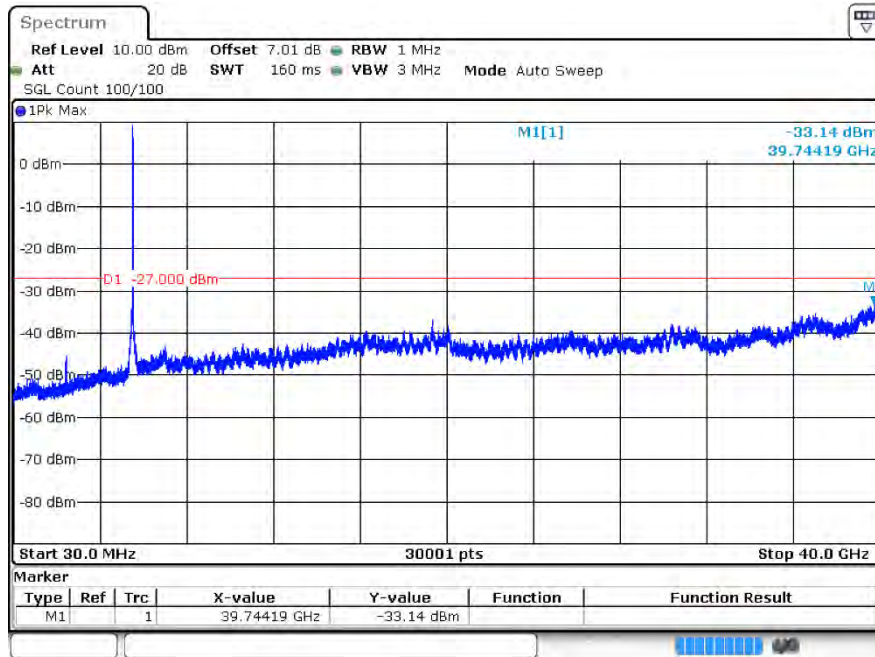


Tx. Spurious n40 5670MHz Ant2

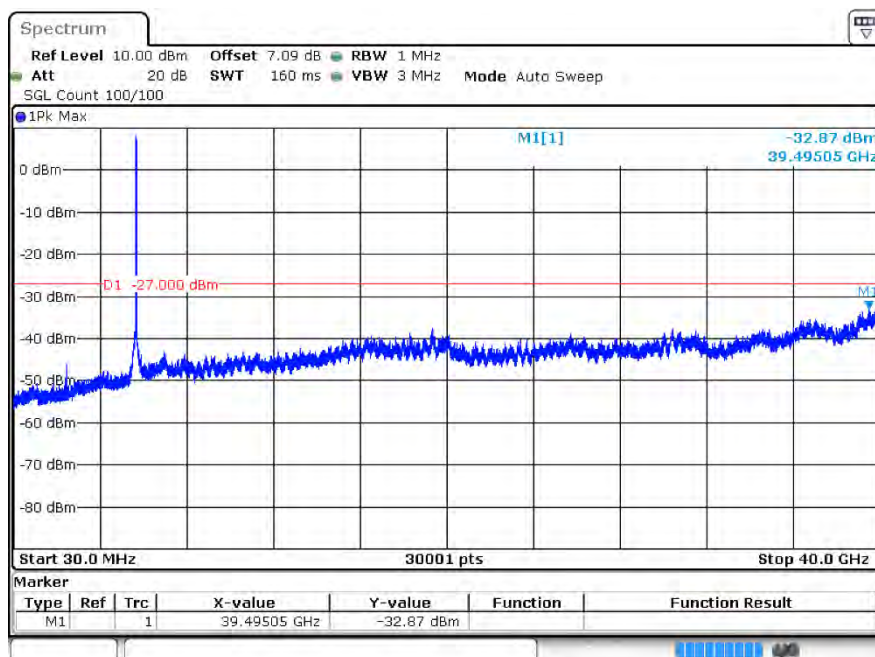


Tx. Spurious ac20 5180MHz Ant2

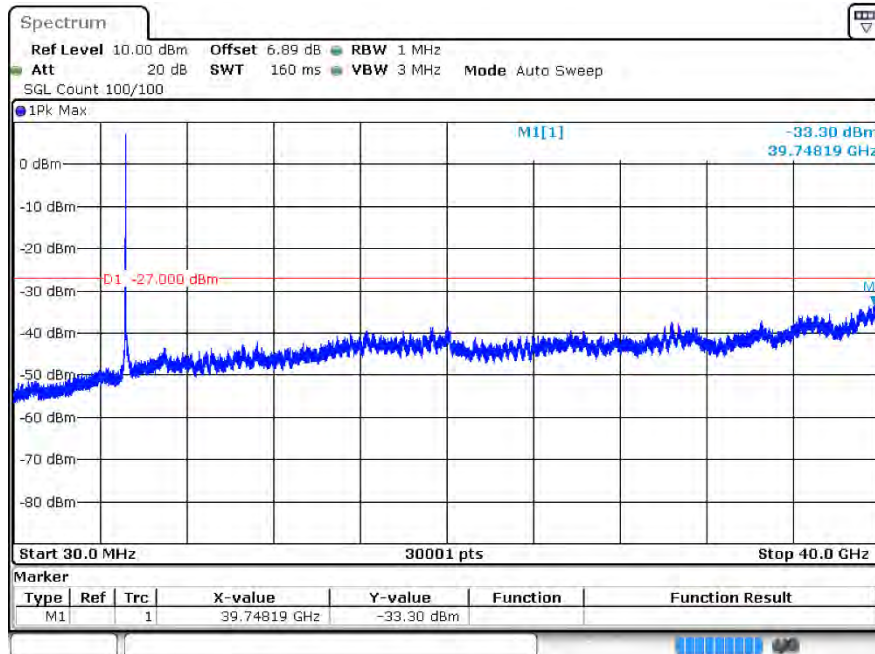


Tx. Spurious ac20 5200MHz Ant2

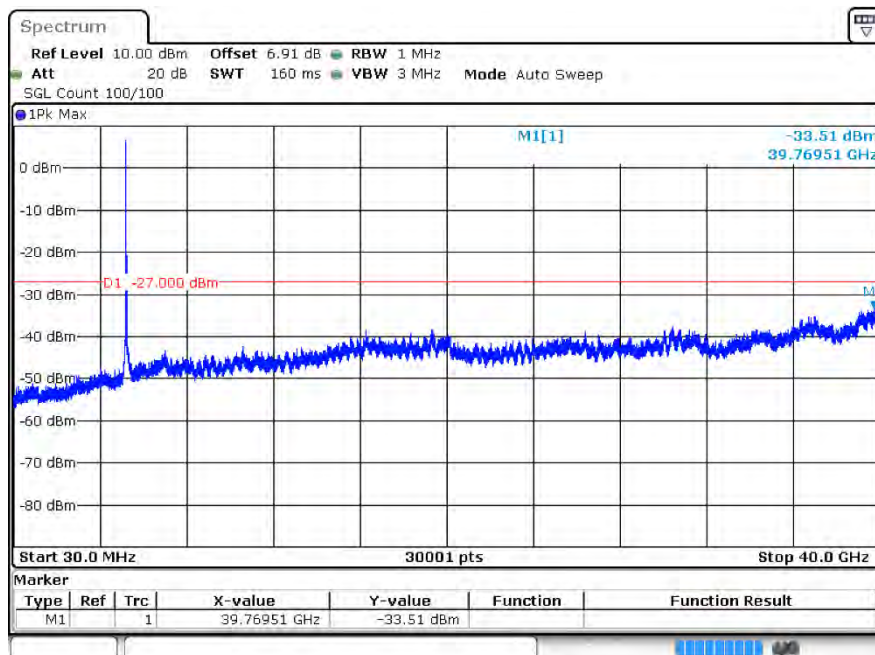


Tx. Spurious ac20 5240MHz Ant2

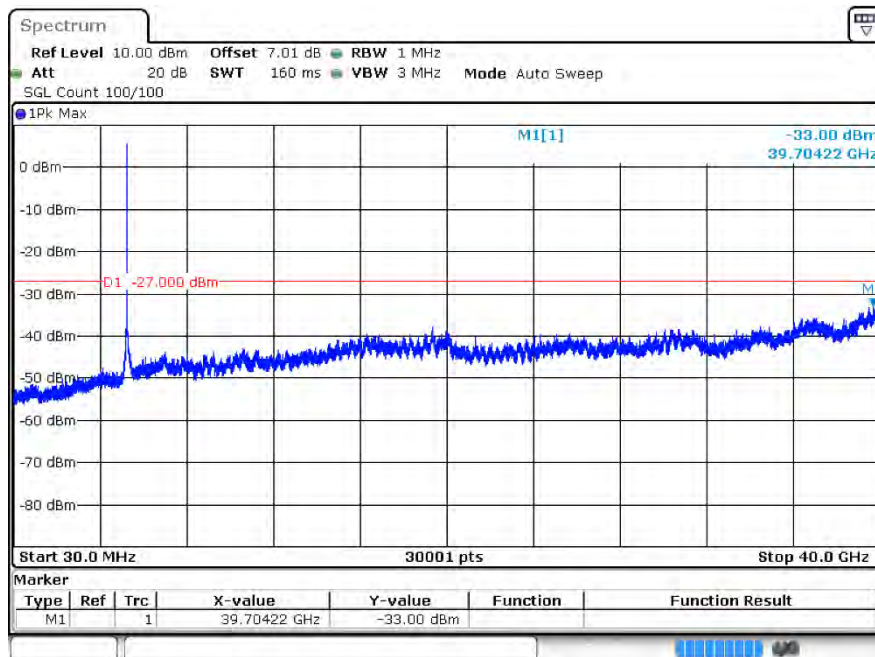


Tx. Spurious ac20 5260MHz Ant2

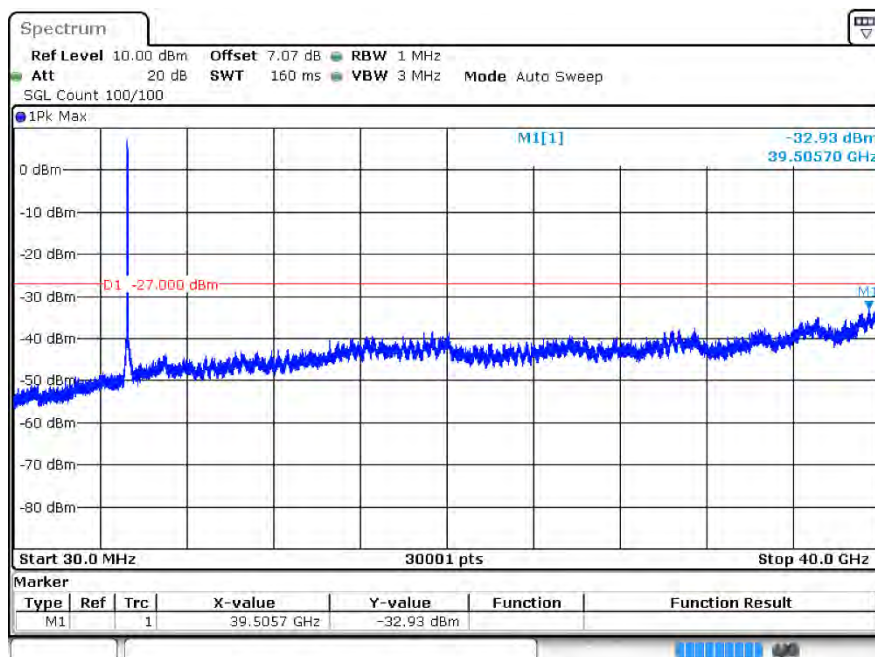


Tx. Spurious ac20 5280MHz Ant2

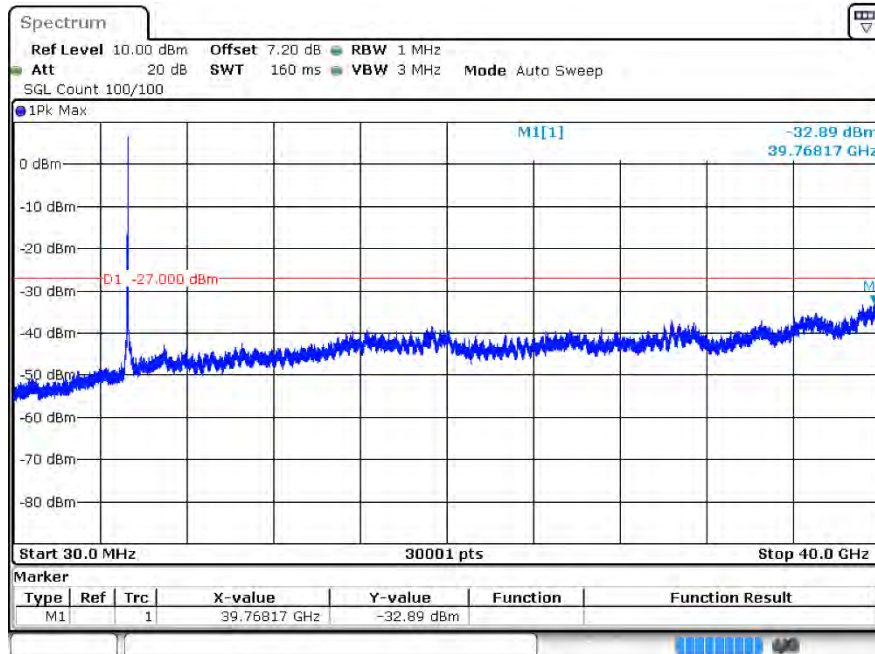


Tx. Spurious ac20 5320MHz Ant2

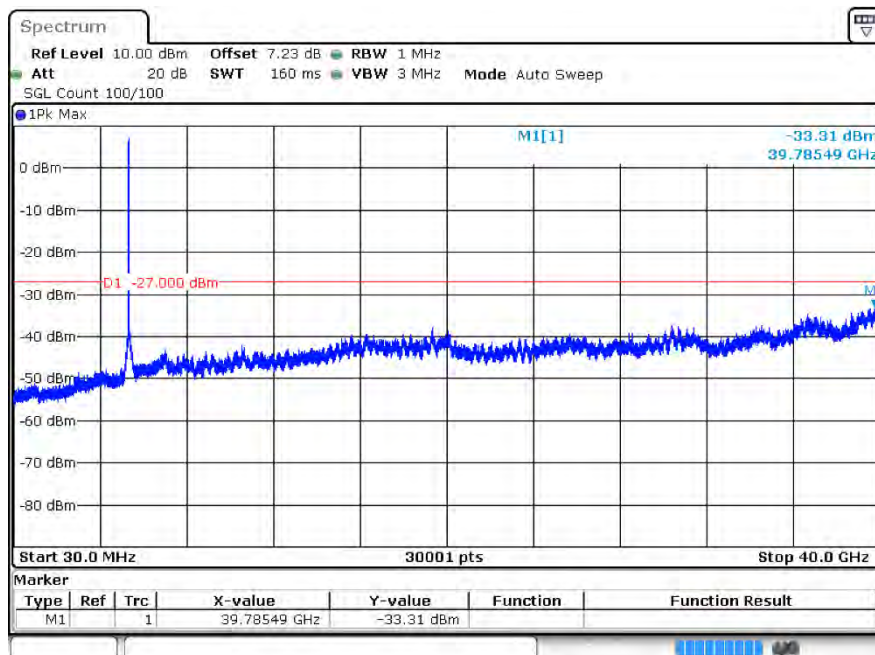


Tx. Spurious ac20 5500MHz Ant2

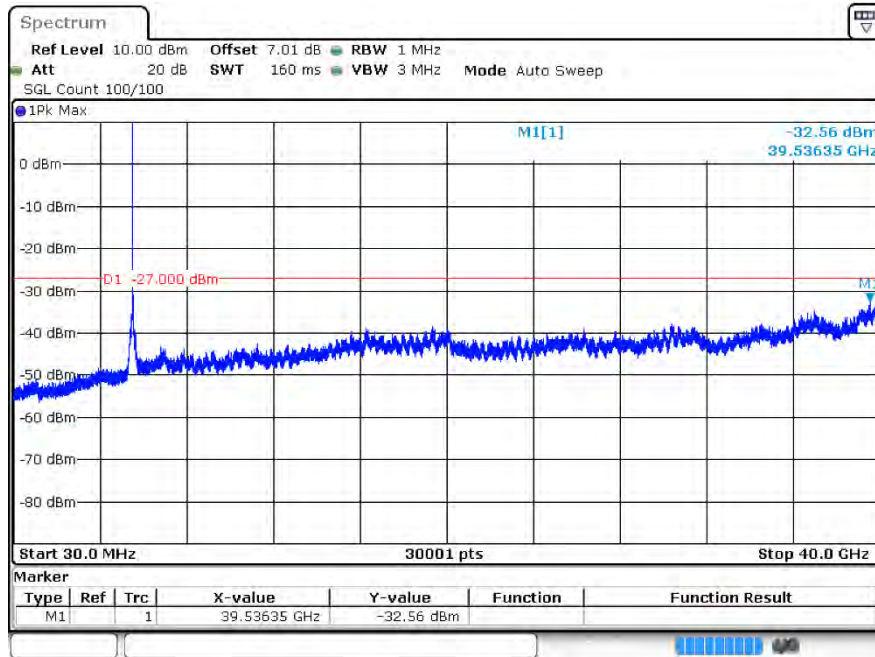


Tx. Spurious ac20 5600MHz Ant2

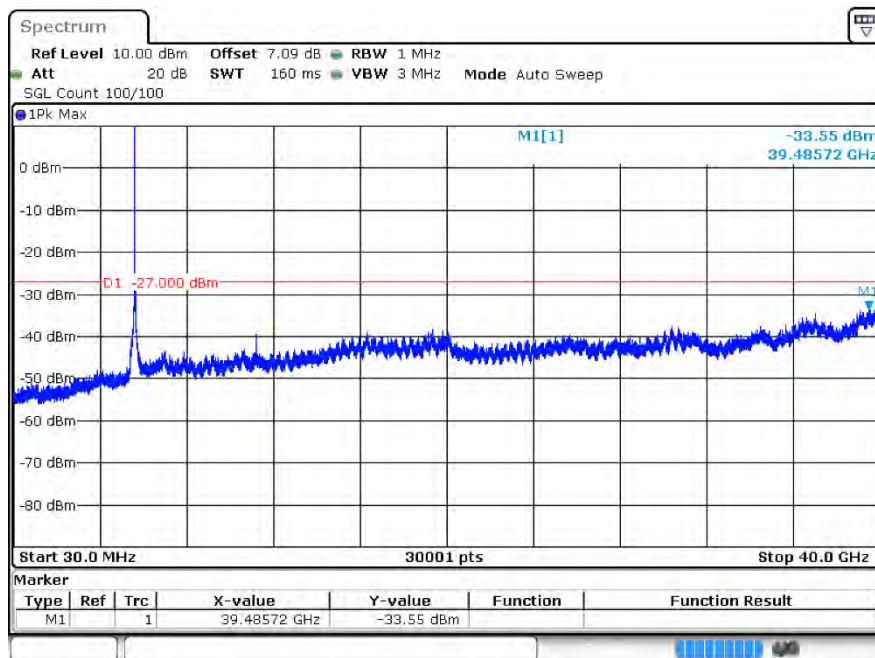


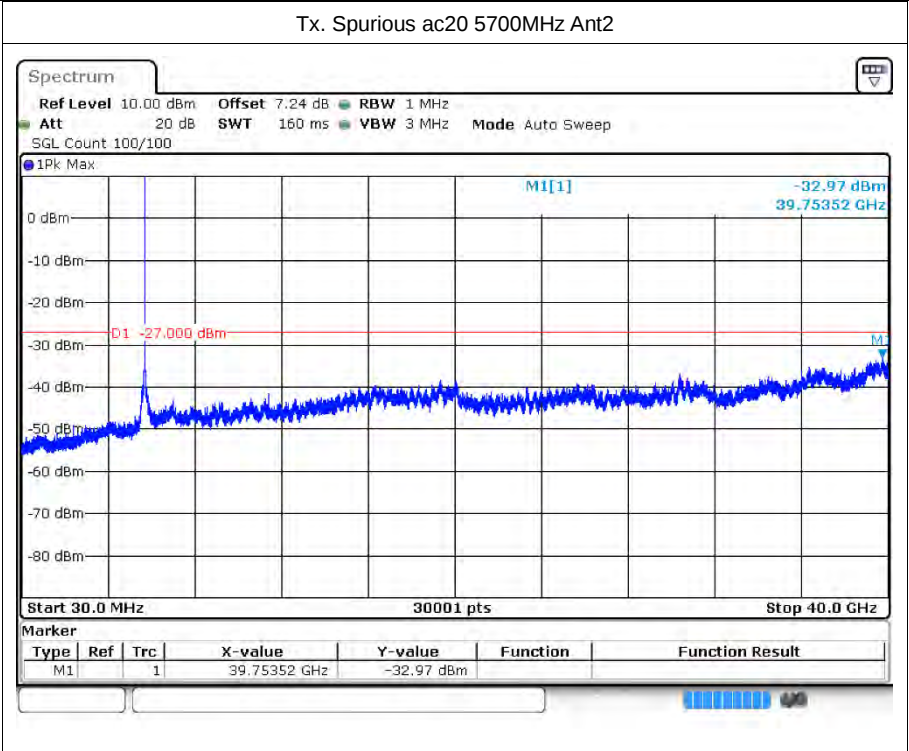


Tx. Spuriousac40 5190MHz Ant2

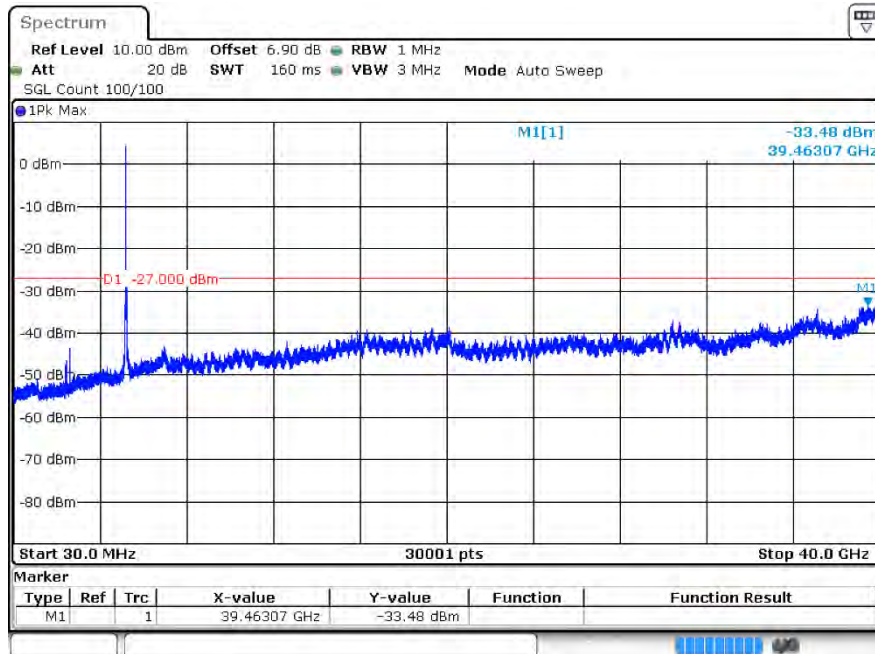


Tx. Spuriousac40 5230MHz Ant2

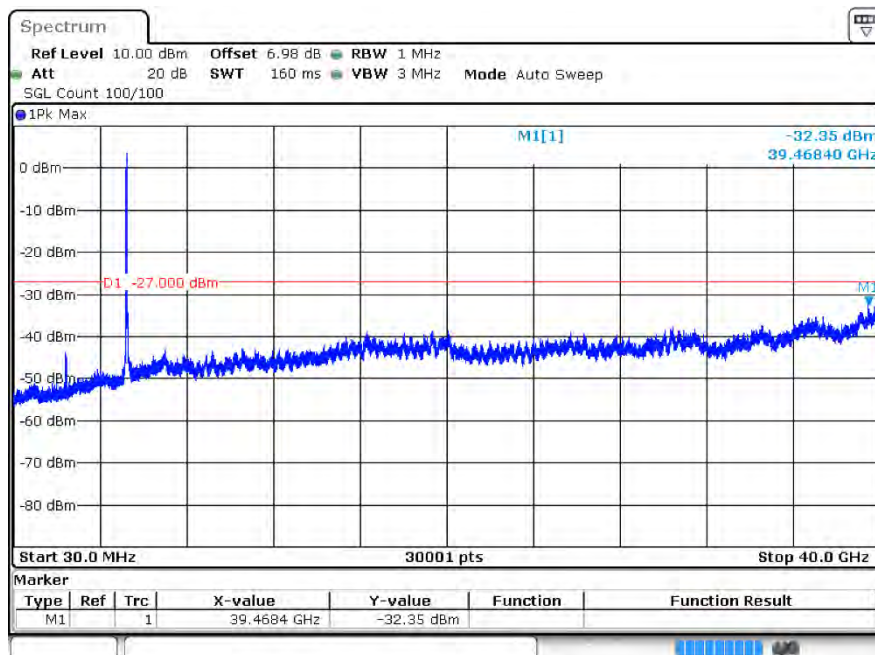


Tx. Spurious ac40 5270MHz Ant2

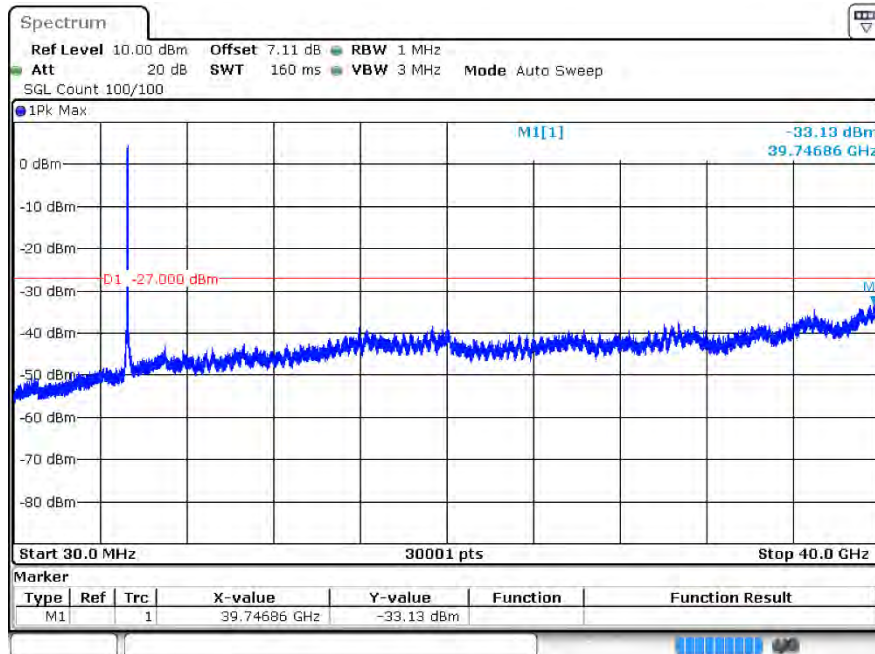


Tx. Spurious ac40 5310MHz Ant2

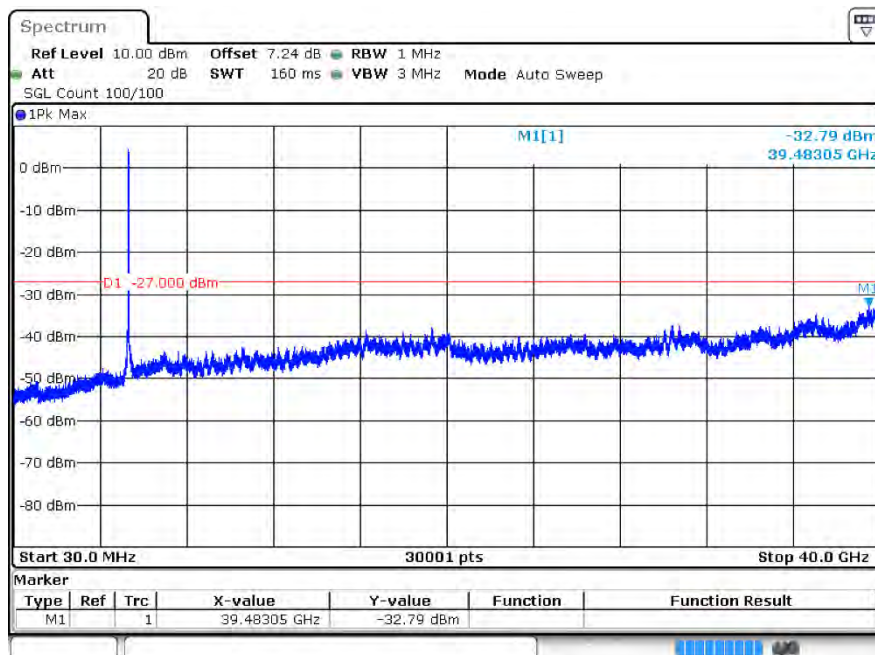


Tx. Spurious ac40 5510MHz Ant2

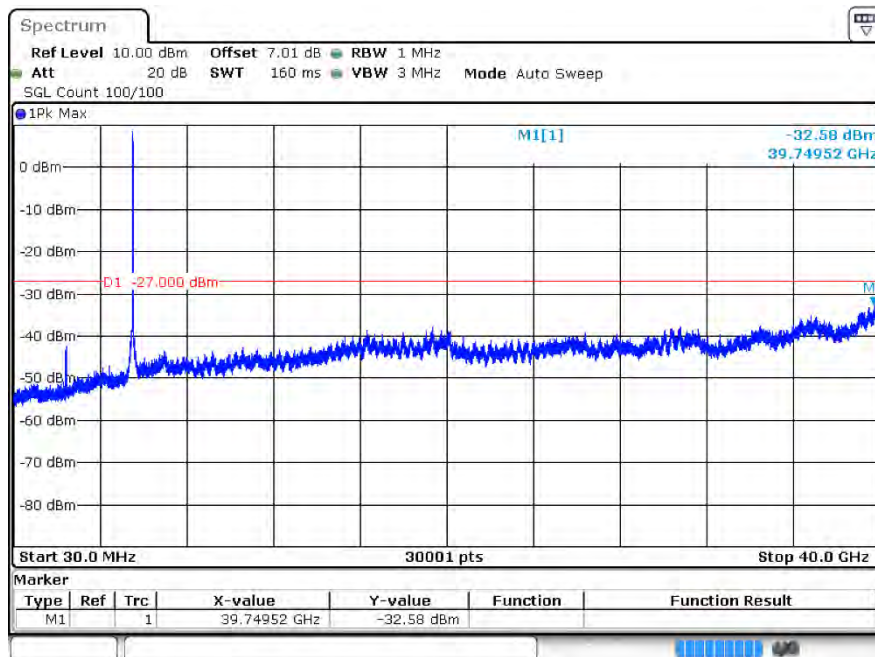


Tx. Spurious ac40 5670MHz Ant2

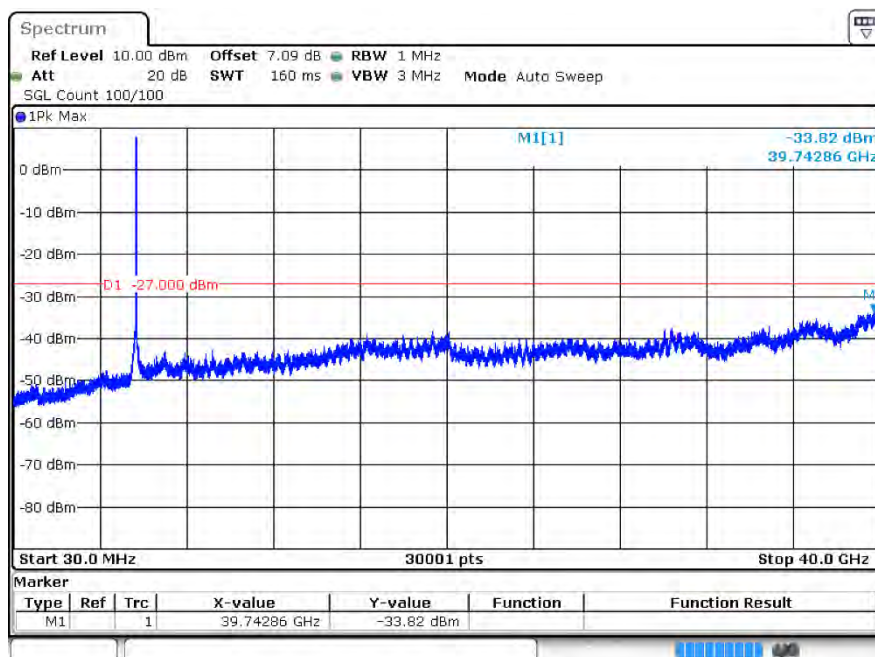


Tx. Spuriousac80 5210MHz Ant2

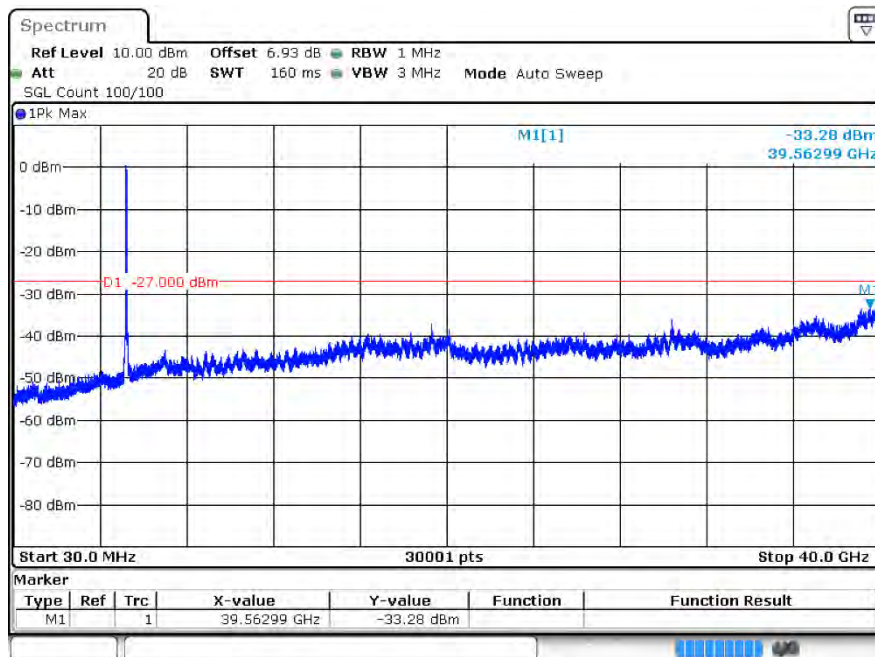


Tx. Spuriousac80 5290MHz Ant2

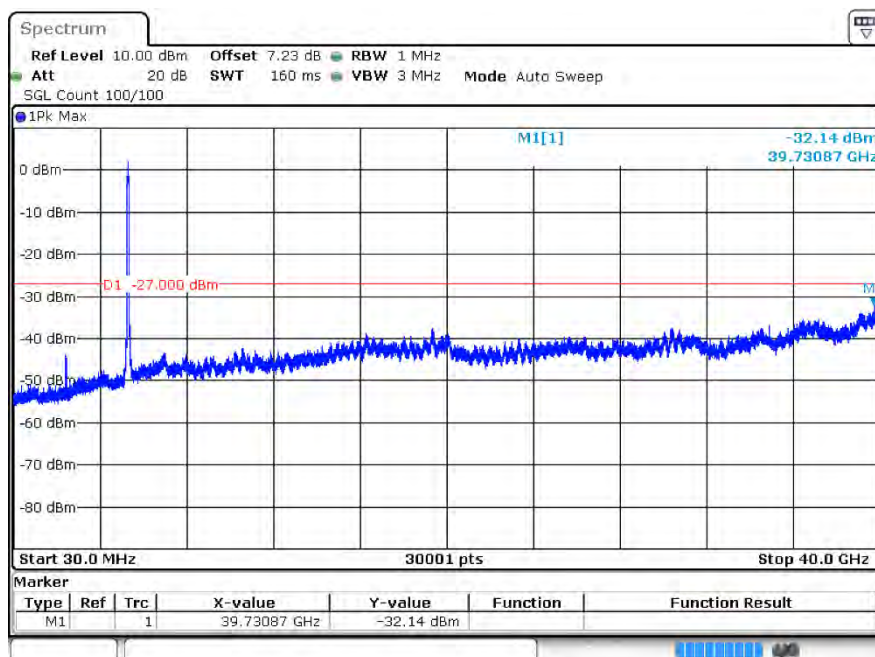


Tx. Spurious ac80 5530MHz Ant2

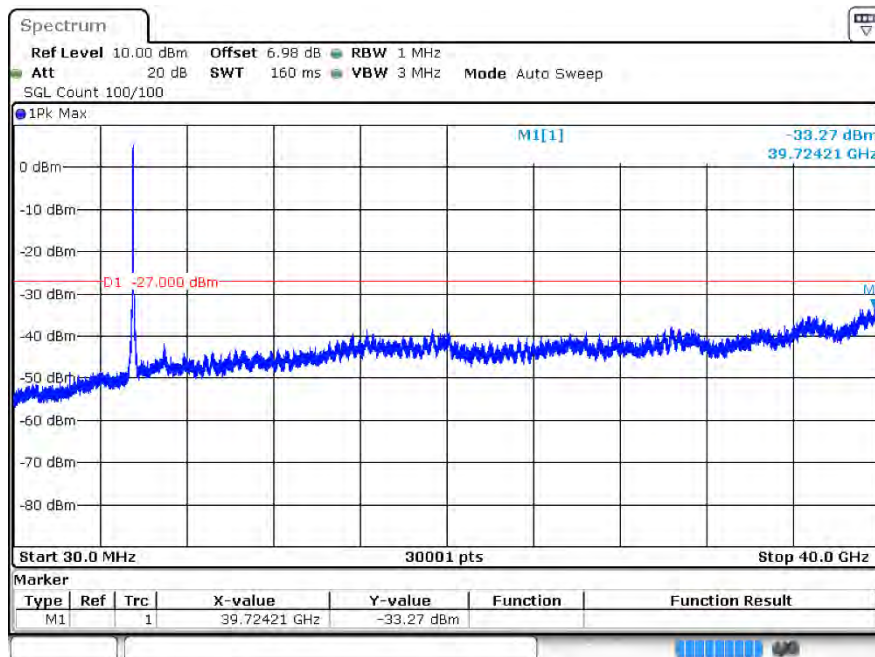


Tx. Spuriousac80 5610MHz Ant2

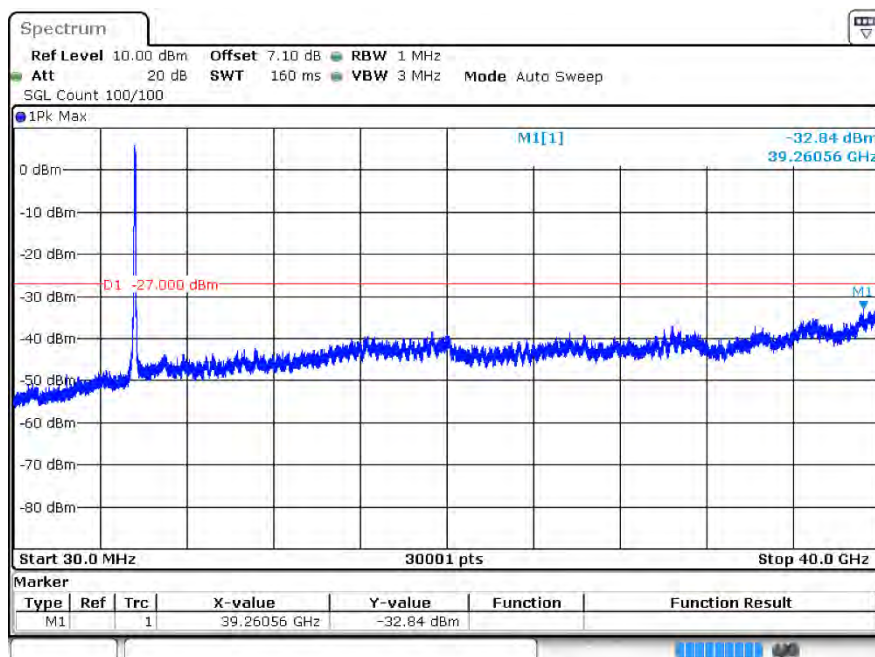


Tx. Spurious ax20 5180MHz Ant2

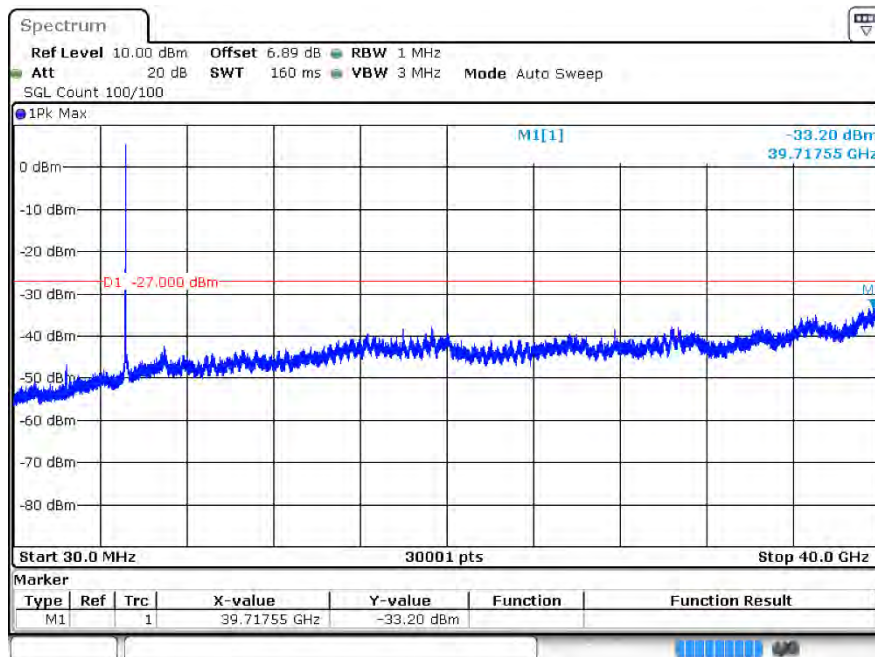


Tx. Spurious ax20 5200MHz Ant2

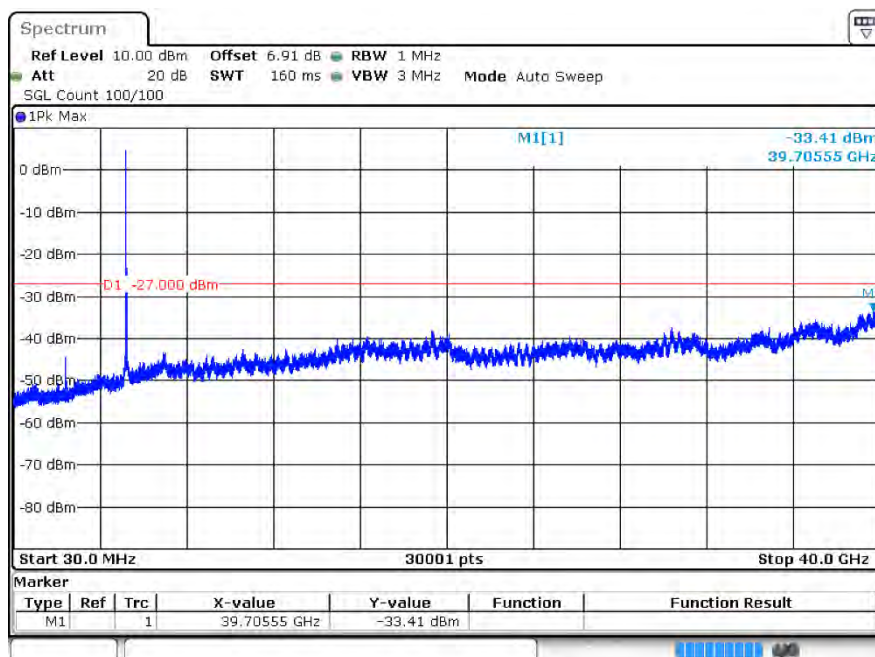


Tx. Spurious ax20 5240MHz Ant2

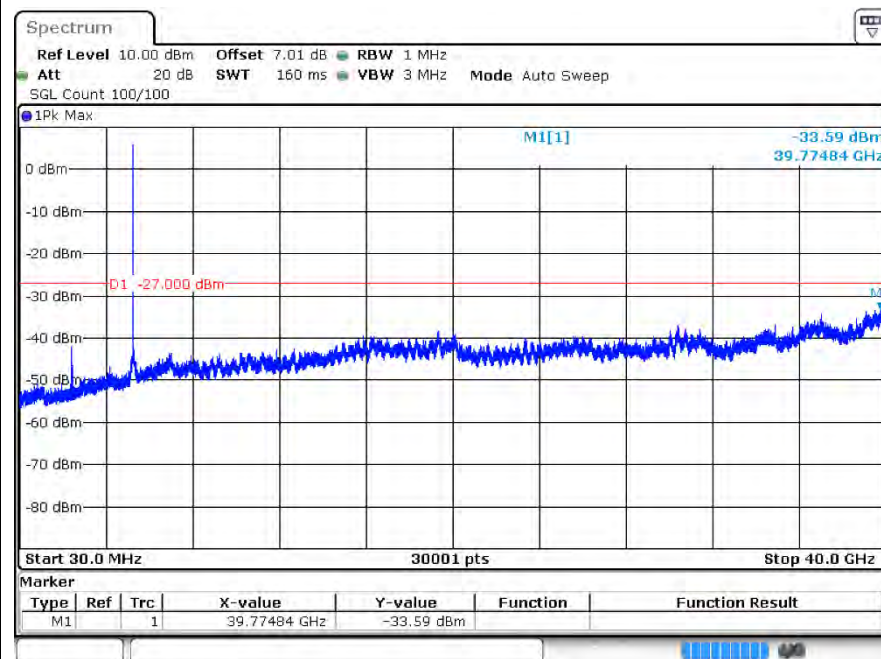


Tx. Spurious ax20 5260MHz Ant2

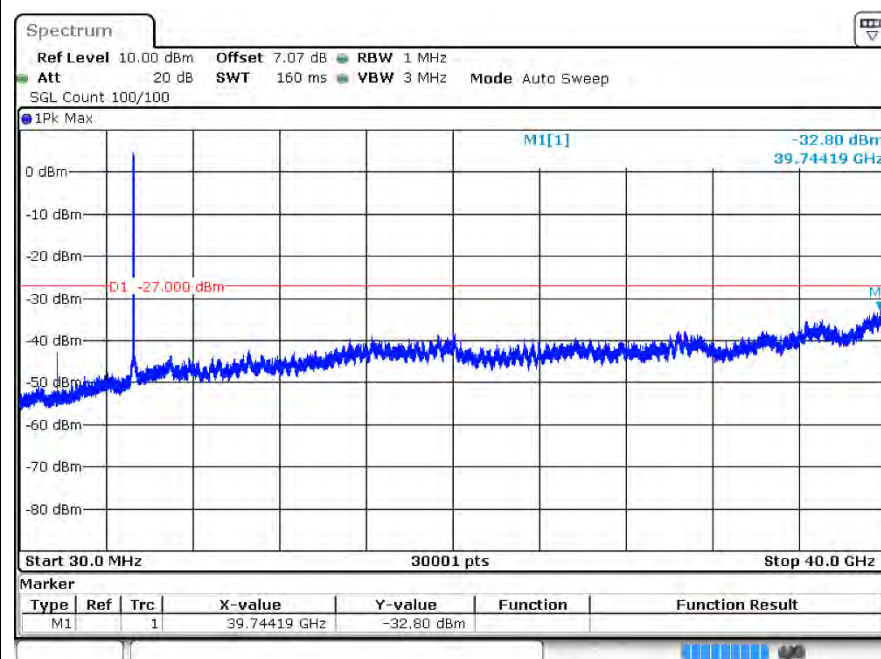

Tx. Spurious ax20 5280MHz Ant2

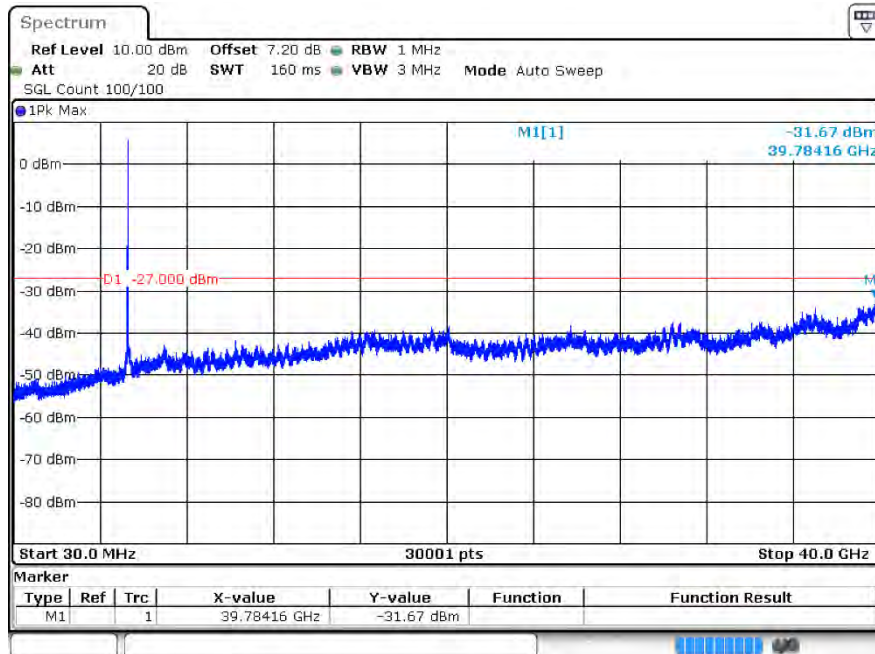


Tx. Spurious ax20 5320MHz Ant2

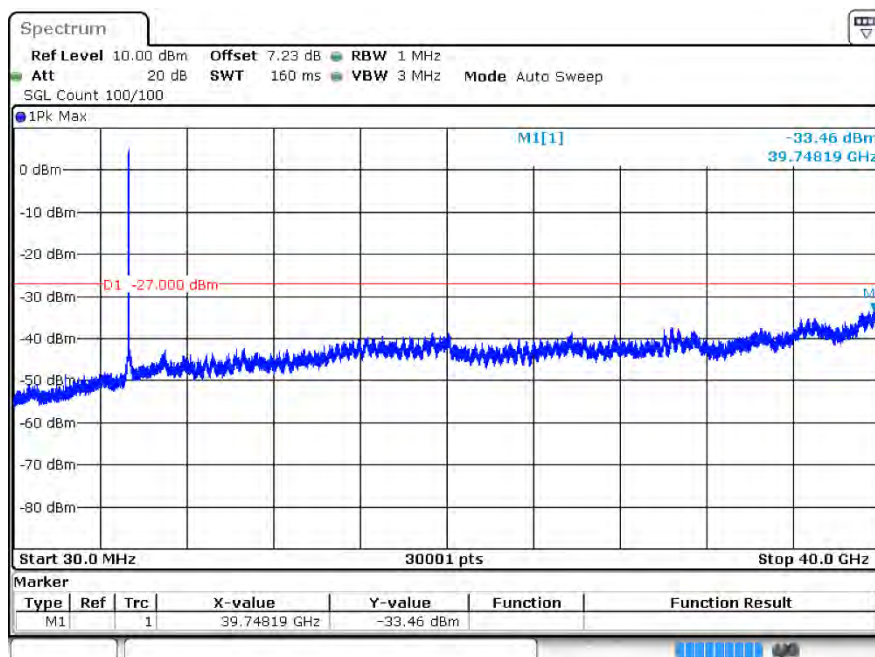





Tx. Spurious ax20 5500MHz Ant2

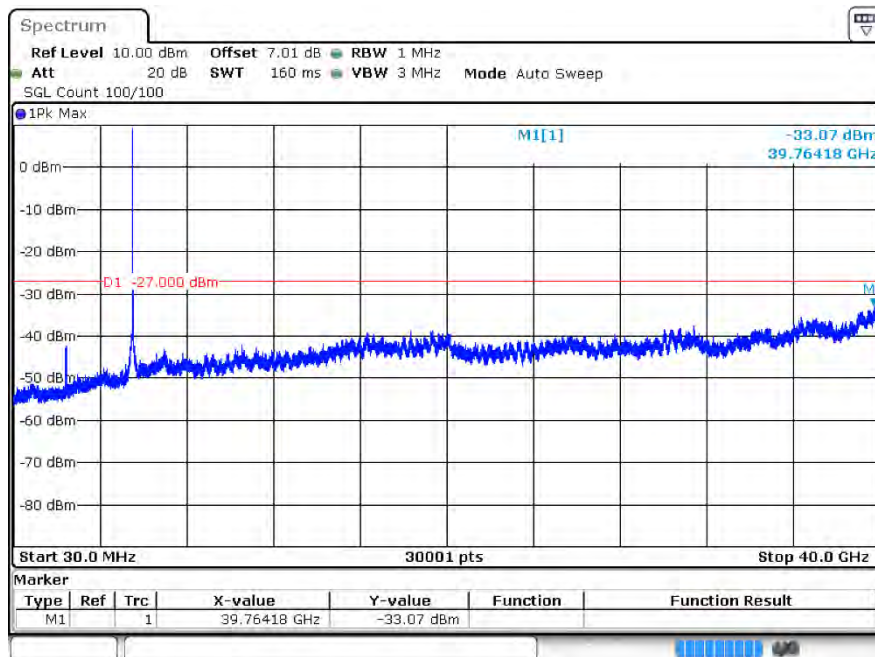


Tx. Spurious ax20 5600MHz Ant2

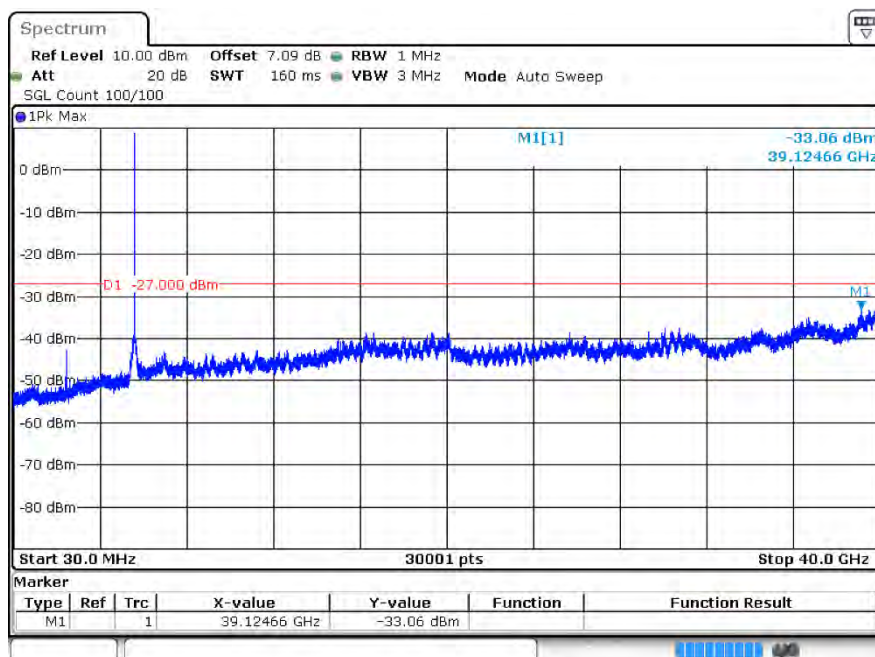


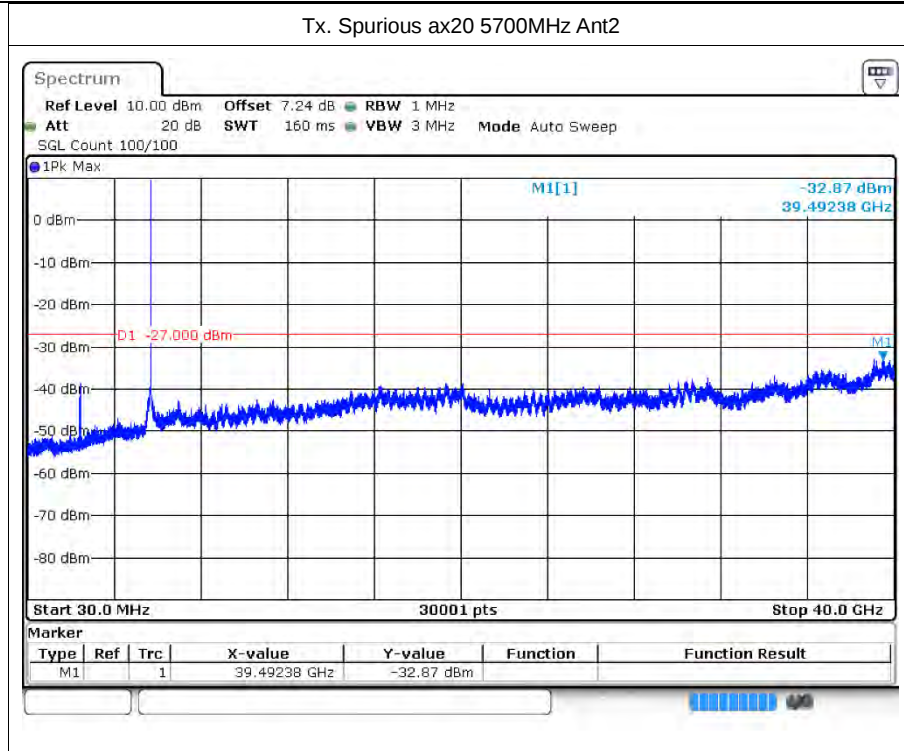


Tx. Spuriousax40 5190MHz Ant2

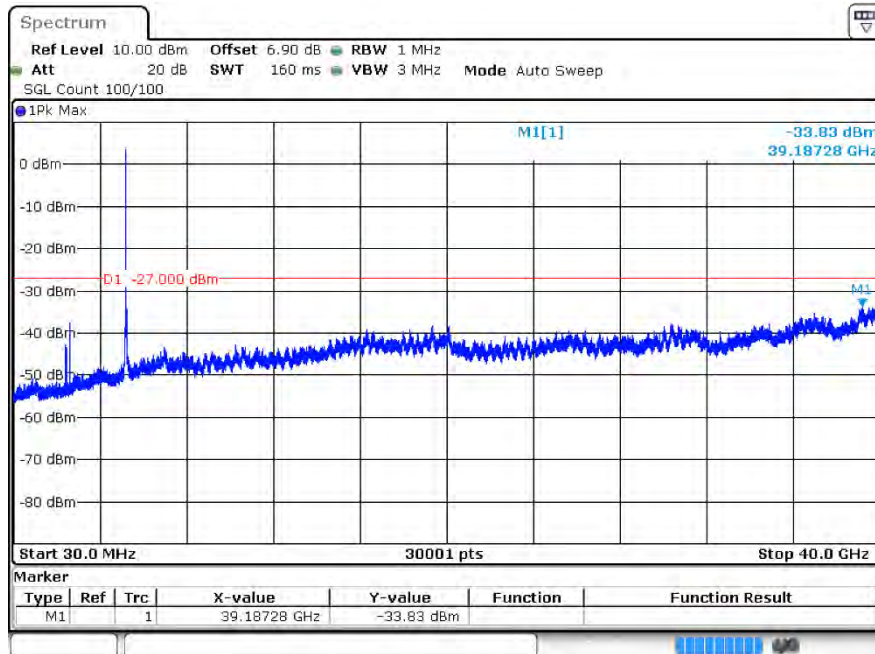


Tx. Spuriousax40 5230MHz Ant2

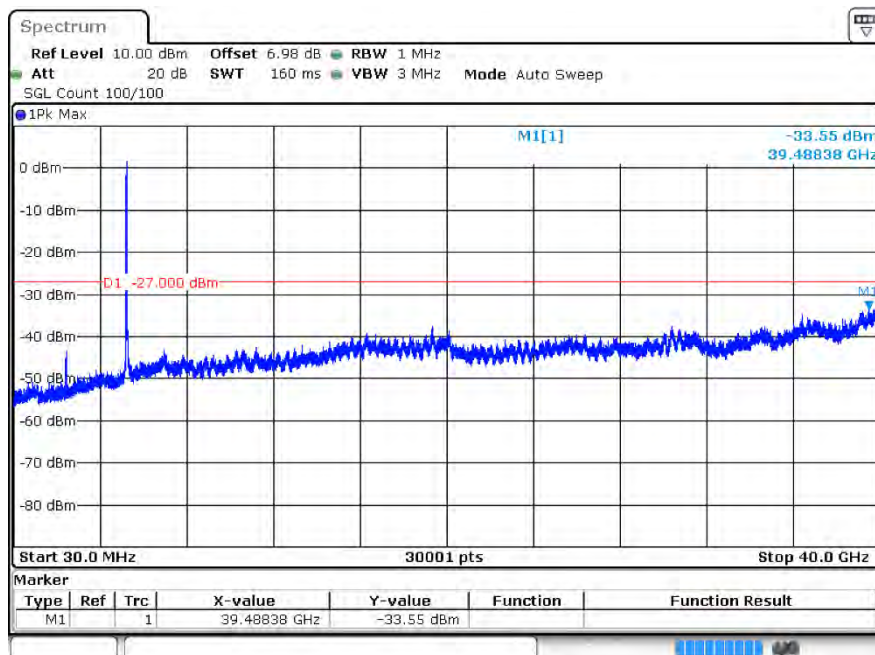


Tx. Spurious ax40 5270MHz Ant2

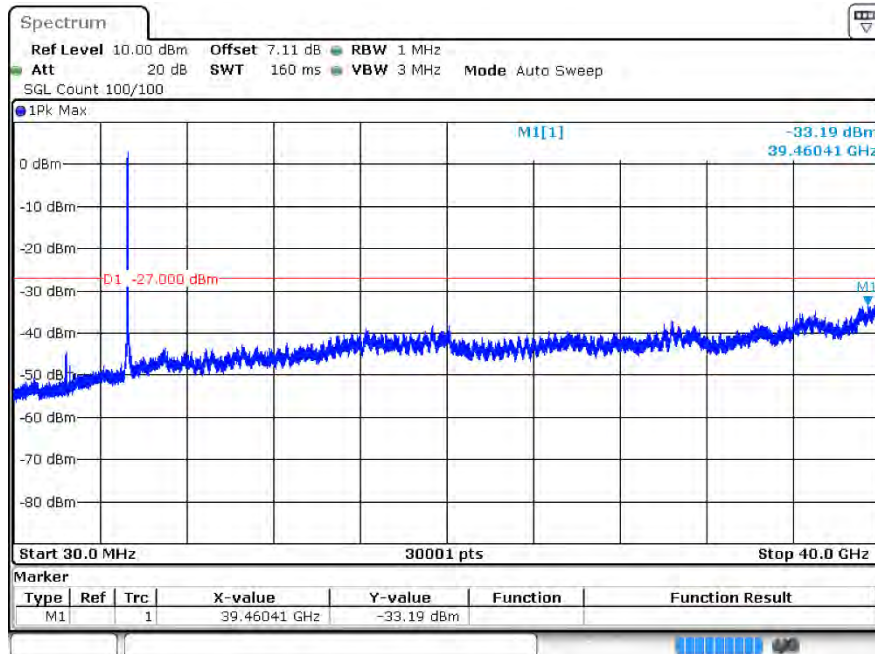


Tx. Spurious ax40 5310MHz Ant2

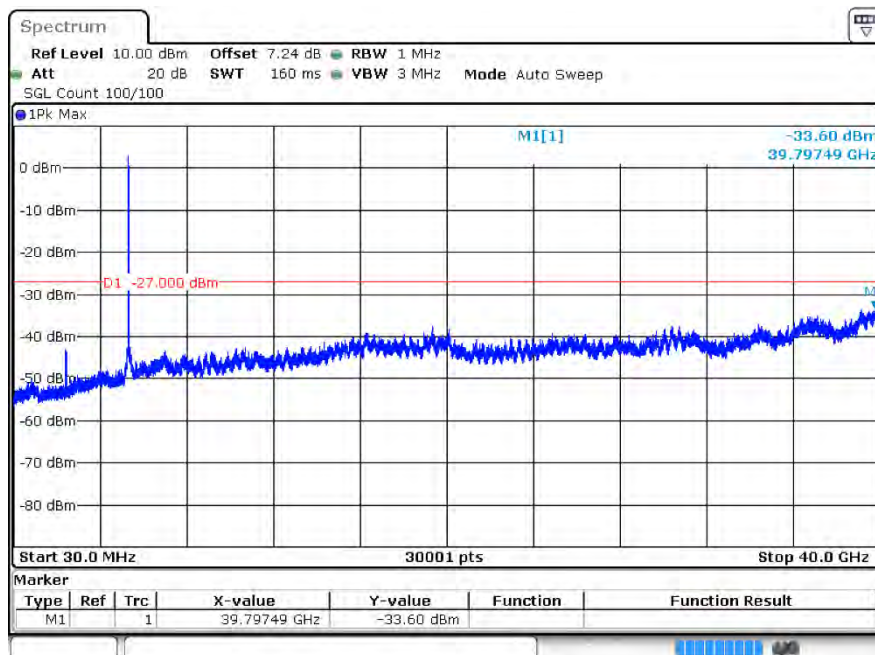


Tx. Spurious ax40 5510MHz Ant2

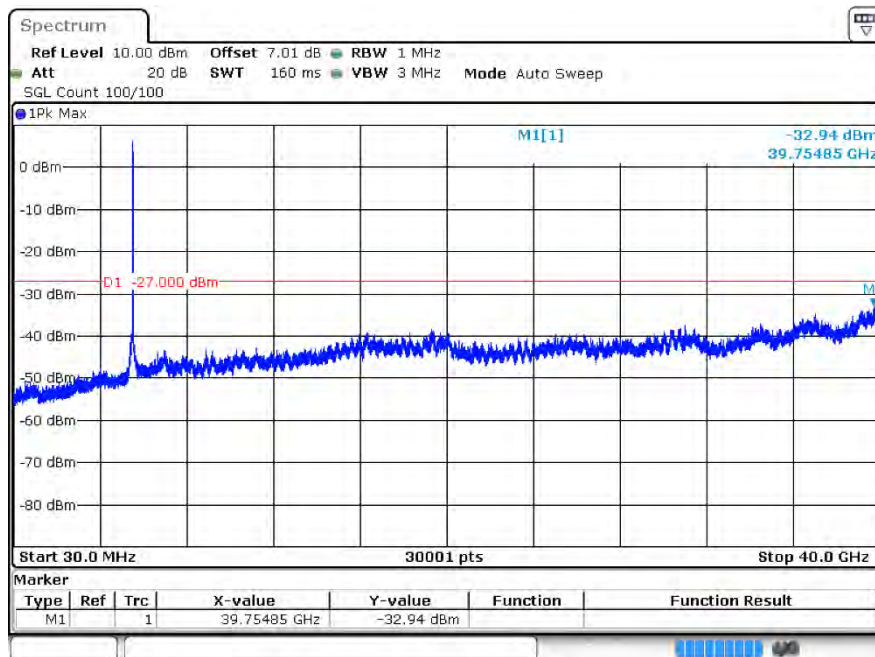


Tx. Spurious ax40 5670MHz Ant2

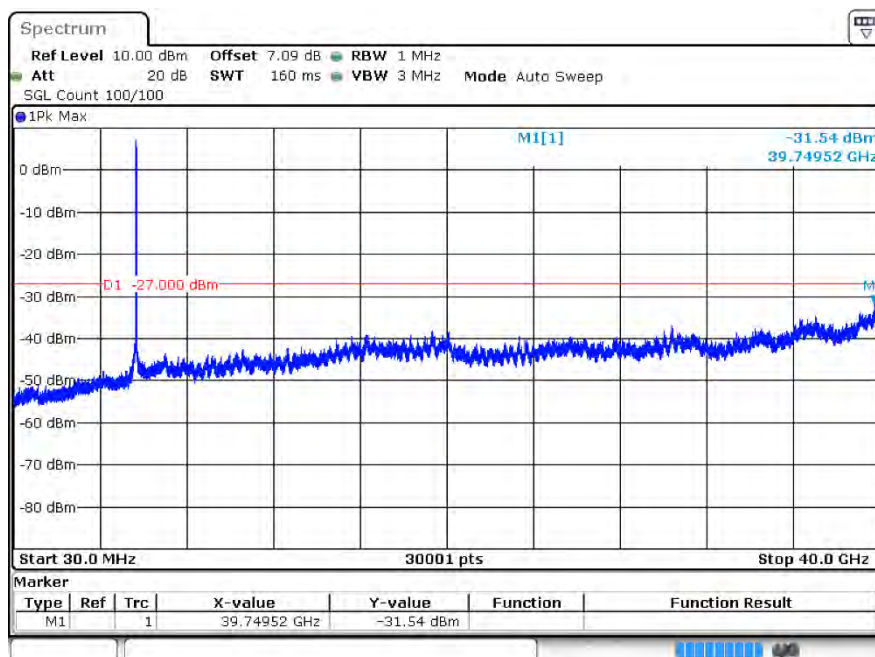


Tx. Spuriousax80 5210MHz Ant2

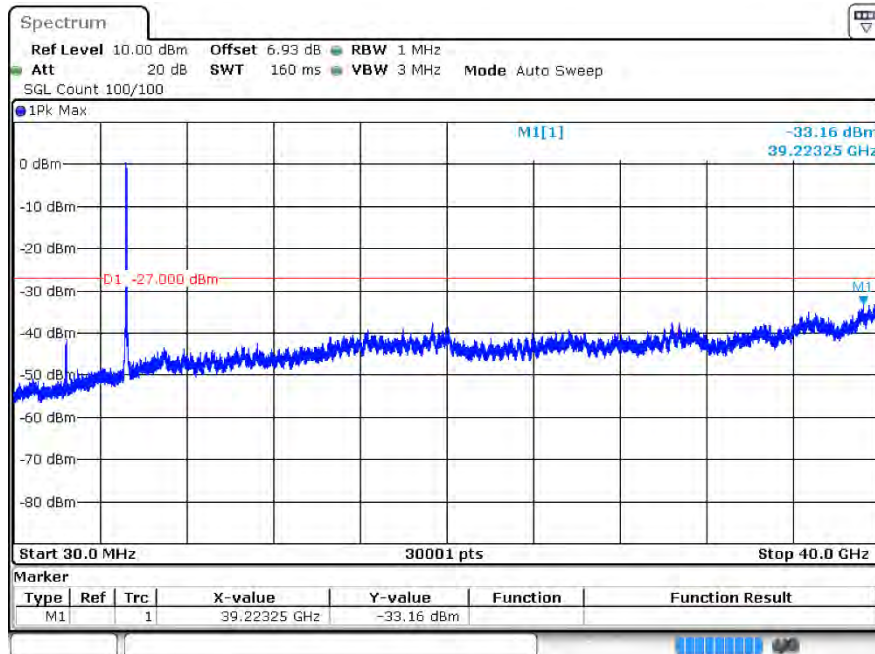


Tx. Spuriousax80 5290MHz Ant2

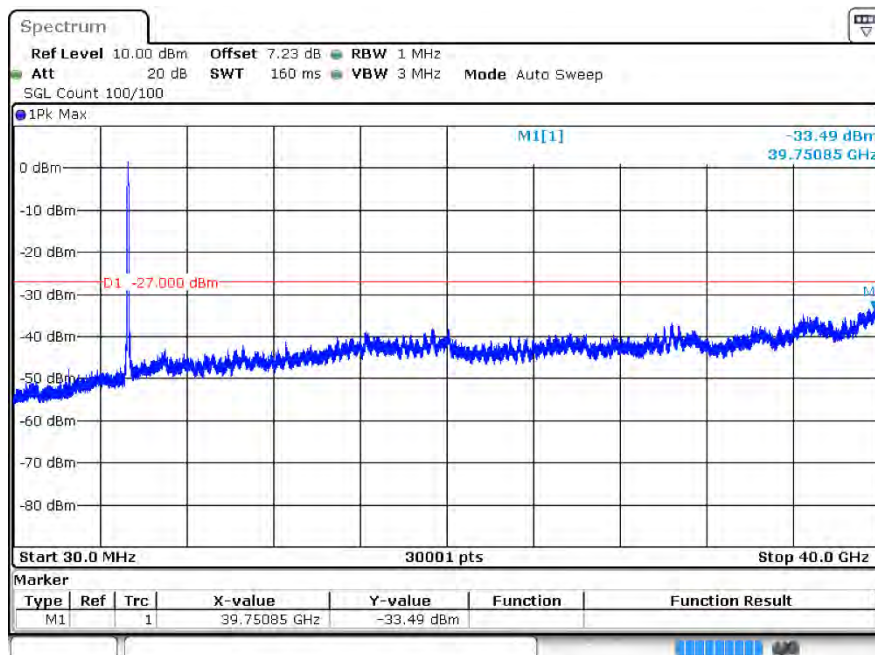

Tx. Spurious ax80 5530MHz Ant2

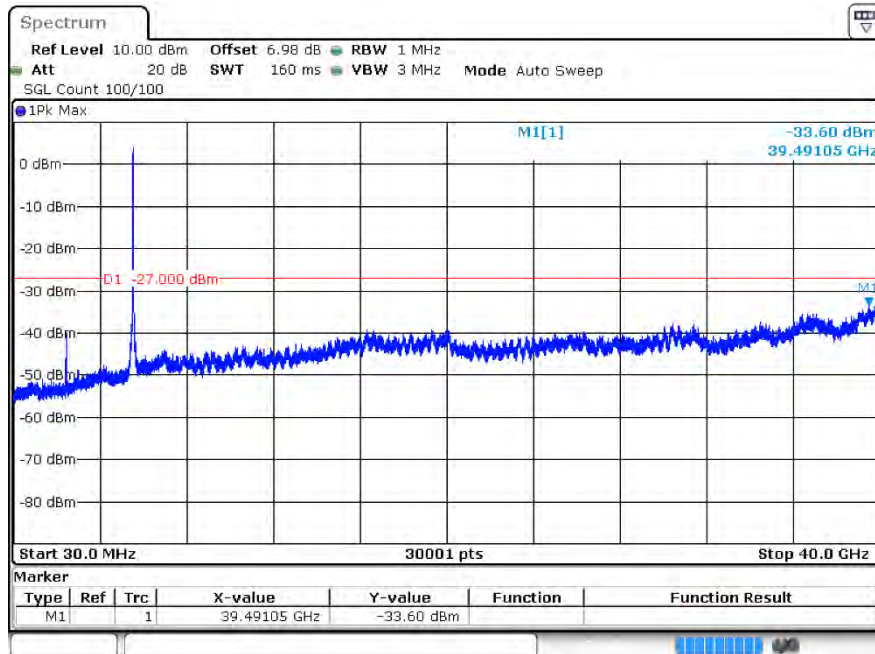

Tx. Spuriousax80 5610MHz Ant2

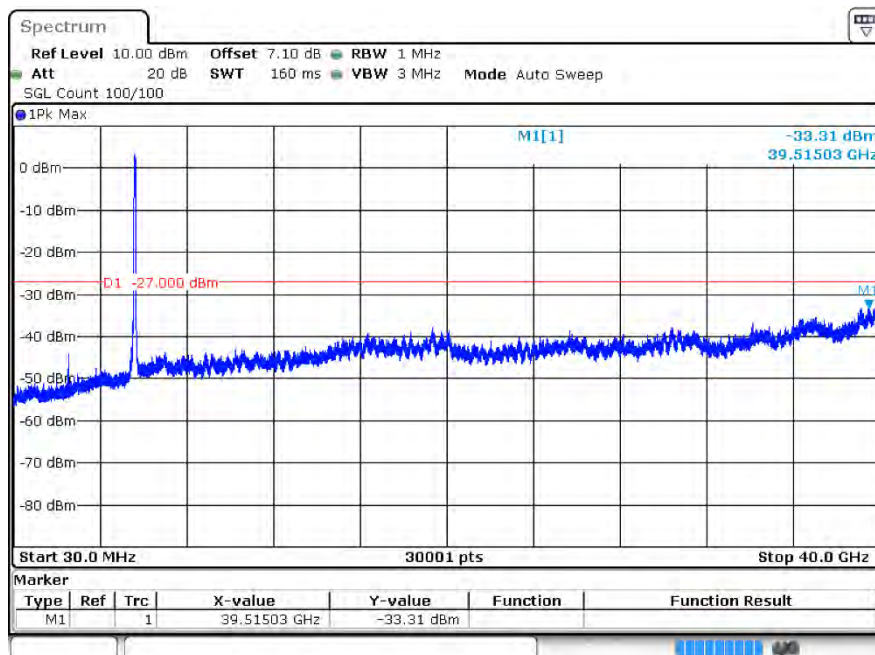



8 Restrict Band

8.1 Test Result

Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
a	5180	Ant1	4500	-41.66	2.35	57.29	Peak	68.2	Pass
a	5180	Ant1	4500	-52.11	2.35	46.84	Average	54	Pass
a	5180	Ant1	5149.6	-34.76	2.35	64.19	Peak	68.2	Pass
a	5180	Ant1	5149.6	-45.91	2.35	53.04	Average	54	Pass
a	5180	Ant1	5150	-37.76	2.35	61.19	Peak	68.2	Pass
a	5180	Ant1	5150	-45.92	2.35	53.03	Average	54	Pass
a	5240	Ant1	5350	-42.71	2.35	56.24	Peak	68.2	Pass
a	5240	Ant1	5350	-50.4	2.35	48.55	Average	54	Pass
a	5240	Ant1	5420.16	-39.31	2.35	59.64	Peak	68.2	Pass
a	5240	Ant1	5446.56	-49	2.35	49.95	Average	54	Pass
a	5240	Ant1	5460	-42.67	2.35	56.28	Peak	68.2	Pass
a	5240	Ant1	5460	-50.78	2.35	48.17	Average	54	Pass
a	5260	Ant1	4500	-41.15	2.35	57.8	Peak	68.2	Pass
a	5260	Ant1	4500	-52.03	2.35	46.92	Average	54	Pass
a	5260	Ant1	5142.72	-37.64	2.35	61.31	Peak	68.2	Pass
a	5260	Ant1	5025.72	-49.47	2.35	49.48	Average	54	Pass
a	5260	Ant1	5150	-40.27	2.35	58.68	Peak	68.2	Pass
a	5260	Ant1	5150	-49.38	2.35	49.57	Average	54	Pass
a	5320	Ant1	5350	-38.39	2.35	60.56	Peak	68.2	Pass
a	5320	Ant1	5350	-46.26	2.35	52.69	Average	54	Pass
a	5320	Ant1	5351.2	-35.55	2.35	63.4	Peak	68.2	Pass
a	5320	Ant1	5351	-45.99	2.35	52.96	Average	54	Pass
a	5320	Ant1	5460	-40.99	2.35	57.96	Peak	68.2	Pass
a	5320	Ant1	5460	-50.05	2.35	48.9	Average	54	Pass
a	5500	Ant1	5460	-38.32	2.35	60.63	Peak	68.2	Pass
a	5500	Ant1	5460	-47.08	2.35	51.87	Average	54	Pass
a	5500	Ant1	5465.4	-36.81	2.35	62.14	Peak	68.2	Pass
a	5500	Ant1	5470	-46.39	2.35	52.56	Average	54	Pass
a	5500	Ant1	5470	-38.02	2.35	60.93	Peak	68.2	Pass
a	5500	Ant1	5470	-46.39	2.35	52.56	Average	54	Pass
a	5700	Ant1	5725	-33.75	2.35	65.2	Peak	68.2	Pass
a	5700	Ant1	5725	-47.66	2.35	51.29	Average	54	Pass
a	5700	Ant1	5725	-33.75	2.35	65.2	Peak	68.2	Pass
a	5700	Ant1	5725	-47.66	2.35	51.29	Average	54	Pass
a	5700	Ant1	5735	-42.45	2.35	56.5	Peak	68.2	Pass



a	5700	Ant1	5735	-50.76	2.35	48.19	Average	54	Pass
n20	5180	Ant1	4500	-42.95	2.35	56	Peak	68.2	Pass
n20	5180	Ant1	4500	-52.06	2.35	46.89	Average	54	Pass
n20	5180	Ant1	5136.3	-37.03	2.35	61.92	Peak	68.2	Pass
n20	5180	Ant1	5148.9	-48.03	2.35	50.92	Average	54	Pass
n20	5180	Ant1	5150	-38.98	2.35	59.97	Peak	68.2	Pass
n20	5180	Ant1	5150	-48.04	2.35	50.91	Average	54	Pass
n20	5240	Ant1	5350	-40.19	2.35	58.76	Peak	68.2	Pass
n20	5240	Ant1	5350	-50.74	2.35	48.21	Average	54	Pass
n20	5240	Ant1	5449.68	-38.62	2.35	60.33	Peak	68.2	Pass
n20	5240	Ant1	5447.04	-49.08	2.35	49.87	Average	54	Pass
n20	5240	Ant1	5460	-40.37	2.35	58.58	Peak	68.2	Pass
n20	5240	Ant1	5460	-50.54	2.35	48.41	Average	54	Pass
n20	5260	Ant1	4500	-43.26	2.35	55.69	Peak	68.2	Pass
n20	5260	Ant1	4500	-51.79	2.35	47.16	Average	54	Pass
n20	5260	Ant1	5138.04	-36.76	2.35	62.19	Peak	68.2	Pass
n20	5260	Ant1	5025.72	-49.45	2.35	49.5	Average	54	Pass
n20	5260	Ant1	5150	-39.12	2.35	59.83	Peak	68.2	Pass
n20	5260	Ant1	5150	-50.16	2.35	48.79	Average	54	Pass
n20	5320	Ant1	5350	-37.52	2.35	61.43	Peak	68.2	Pass
n20	5320	Ant1	5350	-47.05	2.35	51.9	Average	54	Pass
n20	5320	Ant1	5352.2	-36.66	2.35	62.29	Peak	68.2	Pass
n20	5320	Ant1	5350.6	-46.79	2.35	52.16	Average	54	Pass
n20	5320	Ant1	5460	-42.72	2.35	56.23	Peak	68.2	Pass
n20	5320	Ant1	5460	-50.53	2.35	48.42	Average	54	Pass
n20	5500	Ant1	5460	-39.61	2.35	59.34	Peak	68.2	Pass
n20	5500	Ant1	5460	-48	2.35	50.95	Average	54	Pass
n20	5500	Ant1	5468.8	-36.49	2.35	62.46	Peak	68.2	Pass
n20	5500	Ant1	5466.2	-47.58	2.35	51.37	Average	54	Pass
n20	5500	Ant1	5470	-39.04	2.35	59.91	Peak	68.2	Pass
n20	5500	Ant1	5470	-47.71	2.35	51.24	Average	54	Pass
n20	5700	Ant1	5725	-39.4	2.35	59.55	Peak	68.2	Pass
n20	5700	Ant1	5725	-47.15	2.35	51.8	Average	54	Pass
n20	5700	Ant1	5728.6	-38.47	2.35	60.48	Peak	68.2	Pass
n20	5700	Ant1	5726	-47.02	2.35	51.93	Average	54	Pass
n20	5700	Ant1	5735	-40.12	2.35	58.83	Peak	68.2	Pass
n20	5700	Ant1	5735	-48.17	2.35	50.78	Average	54	Pass
n40	5190	Ant1	4500	-42.48	2.35	56.47	Peak	68.2	Pass
n40	5190	Ant1	4500	-50.75	2.35	48.2	Average	54	Pass
n40	5190	Ant1	5148.24	-37.02	2.35	61.93	Peak	68.2	Pass
n40	5190	Ant1	5149.7	-47.53	2.35	51.42	Average	54	Pass
n40	5190	Ant1	5150	-37.75	2.35	61.2	Peak	68.2	Pass
n40	5190	Ant1	5150	-48.41	2.35	50.54	Average	54	Pass



n40	5230	Ant1	5350	-43.12	2.35	55.83	Peak	68.2	Pass
n40	5230	Ant1	5350	-49.29	2.35	49.66	Average	54	Pass
n40	5230	Ant1	5455.14	-38.87	2.35	60.08	Peak	68.2	Pass
n40	5230	Ant1	5448.66	-47.15	2.35	51.8	Average	54	Pass
n40	5230	Ant1	5460	-40.13	2.35	58.82	Peak	68.2	Pass
n40	5230	Ant1	5460	-49.39	2.35	49.56	Average	54	Pass
n40	5270	Ant1	4500	-42.51	2.35	56.44	Peak	68.2	Pass
n40	5270	Ant1	4500	-51.46	2.35	47.49	Average	54	Pass
n40	5270	Ant1	4775.4	-38.64	2.35	60.31	Peak	68.2	Pass
n40	5270	Ant1	4963.32	-48.36	2.35	50.59	Average	54	Pass
n40	5270	Ant1	5150	-39.08	2.35	59.87	Peak	68.2	Pass
n40	5270	Ant1	5150	-49.74	2.35	49.21	Average	54	Pass
n40	5310	Ant1	5350	-42.4	2.35	56.55	Peak	68.2	Pass
n40	5310	Ant1	5350	-48.75	2.35	50.2	Average	54	Pass
n40	5310	Ant1	5381.6	-38.36	2.35	60.59	Peak	68.2	Pass
n40	5310	Ant1	5353.8	-47.18	2.35	51.77	Average	54	Pass
n40	5310	Ant1	5460	-41.96	2.35	56.99	Peak	68.2	Pass
n40	5310	Ant1	5460	-49.41	2.35	49.54	Average	54	Pass
n40	5510	Ant1	5460	-40.86	2.35	58.09	Peak	68.2	Pass
n40	5510	Ant1	5460	-48.11	2.35	50.84	Average	54	Pass
n40	5510	Ant1	5465	-35.82	2.35	63.13	Peak	68.2	Pass
n40	5510	Ant1	-46.06	-46.06	2.35	52.89	Average	54	Pass
n40	5510	Ant1	5470	-41.79	2.35	57.16	Peak	68.2	Pass
n40	5510	Ant1	5470	-47.18	2.35	51.77	Average	54	Pass
n40	5670	Ant1	5725	-38.26	2.35	60.69	Peak	68.2	Pass
n40	5670	Ant1	5725	-47.34	2.35	51.61	Average	54	Pass
n40	5670	Ant1	5727.2	-37.21	2.35	61.74	Peak	68.2	Pass
n40	5670	Ant1	5727.6	-47.31	2.35	51.64	Average	54	Pass
n40	5670	Ant1	-39.37	-39.37	2.35	59.58	Peak	68.2	Pass
n40	5670	Ant1	5735	-48.28	2.35	50.67	Average	54	Pass
ac20	5180	Ant1	4500	-42.26	2.35	56.69	Peak	68.2	Pass
ac20	5180	Ant1	4500	-51.8	2.35	47.15	Average	54	Pass
ac20	5180	Ant1	5148.9	-37.09	2.35	61.86	Peak	68.2	Pass
ac20	5180	Ant1	5149.6	-47.31	2.35	51.64	Average	54	Pass
ac20	5180	Ant1	5150	-37.9	2.35	61.05	Peak	68.2	Pass
ac20	5180	Ant1	5150	-47.36	2.35	51.59	Average	54	Pass
ac20	5240	Ant1	5350	-41.6	2.35	57.35	Peak	68.2	Pass
ac20	5240	Ant1	5350	-50.81	2.35	48.14	Average	54	Pass
ac20	5240	Ant1	5451.6	-38.49	2.35	60.46	Peak	68.2	Pass
ac20	5240	Ant1	5447.76	-48.51	2.35	50.44	Average	54	Pass
ac20	5240	Ant1	5460	-41.2	2.35	57.75	Peak	68.2	Pass
ac20	5240	Ant1	5460	-50.58	2.35	48.37	Average	54	Pass
ac20	5260	Ant1	4500	-42.32	2.35	56.63	Peak	68.2	Pass



ac20	5260	Ant1	4500	-51.82	2.35	47.13	Average	54	Pass
ac20	5260	Ant1	5131.02	-38.97	2.35	59.98	Peak	68.2	Pass
ac20	5260	Ant1	5026.5	-49.14	2.35	49.81	Average	54	Pass
ac20	5260	Ant1	5150	-39.39	2.35	59.56	Peak	68.2	Pass
ac20	5260	Ant1	5150	-49.67	2.35	49.28	Average	54	Pass
ac20	5320	Ant1	5350	-39.43	2.35	59.52	Peak	68.2	Pass
ac20	5320	Ant1	5350	-46.68	2.35	52.27	Average	54	Pass
ac20	5320	Ant1	5376.8	-36.81	2.35	62.14	Peak	68.2	Pass
ac20	5320	Ant1	5350	-46.68	2.35	52.27	Average	54	Pass
ac20	5320	Ant1	5460	-42.07	2.35	56.88	Peak	68.2	Pass
ac20	5320	Ant1	5460	-50.03	2.35	48.92	Average	54	Pass
ac20	5500	Ant1	5460	-38.97	2.35	59.98	Peak	68.2	Pass
ac20	5500	Ant1	5460	-47.71	2.35	51.24	Average	54	Pass
ac20	5500	Ant1	5466	-38.52	2.35	60.43	Peak	68.2	Pass
ac20	5500	Ant1	5470	-47.27	2.35	51.68	Average	54	Pass
ac20	5500	Ant1	5470	-39.29	2.35	59.66	Peak	68.2	Pass
ac20	5500	Ant1	5470	-47.27	2.35	51.68	Average	54	Pass
ac20	5700	Ant1	5725	-37.91	2.35	61.04	Peak	68.2	Pass
ac20	5700	Ant1	5725	-46.64	2.35	52.31	Average	54	Pass
ac20	5700	Ant1	5732.2	-36.56	2.35	62.39	Peak	68.2	Pass
ac20	5700	Ant1	5725	-46.64	2.35	52.31	Average	54	Pass
ac20	5700	Ant1	5735	-37.85	2.35	61.1	Peak	68.2	Pass
ac20	5700	Ant1	5735	-47.85	2.35	51.1	Average	54	Pass
ac40	5190	Ant1	4500	-41.36	2.35	57.59	Peak	68.2	Pass
ac40	5190	Ant1	4500	-50.88	2.35	48.07	Average	54	Pass
ac40	5190	Ant1	5147.51	-38.11	2.35	60.84	Peak	68.2	Pass
ac40	5190	Ant1	5129.26	-47.45	2.35	51.5	Average	54	Pass
ac40	5190	Ant1	5150	-39.72	2.35	59.23	Peak	68.2	Pass
ac40	5190	Ant1	5150	-47.28	2.35	51.67	Average	54	Pass
ac40	5230	Ant1	5350	-42.1	2.35	56.85	Peak	68.2	Pass
ac40	5230	Ant1	5350	-50.14	2.35	48.81	Average	54	Pass
ac40	5230	Ant1	5451.09	-38.45	2.35	60.5	Peak	68.2	Pass
ac40	5230	Ant1	5447.31	-47.12	2.35	51.83	Average	54	Pass
ac40	5230	Ant1	5460	-40.64	2.35	58.31	Peak	68.2	Pass
ac40	5230	Ant1	5460	-49.6	2.35	49.35	Average	54	Pass
ac40	5270	Ant1	4500	-41.99	2.35	56.96	Peak	68.2	Pass
ac40	5270	Ant1	4500	-50.4	2.35	48.55	Average	54	Pass
ac40	5270	Ant1	4959.27	-38.25	2.35	60.7	Peak	68.2	Pass
ac40	5270	Ant1	4961.7	-47.3	2.35	51.65	Average	54	Pass
ac40	5270	Ant1	5150	-41.51	2.35	57.44	Peak	68.2	Pass
ac40	5270	Ant1	5150	-49.31	2.35	49.64	Average	54	Pass
ac40	5310	Ant1	5350	-41.02	2.35	57.93	Peak	68.2	Pass
ac40	5310	Ant1	5350	-47.9	2.35	51.05	Average	54	Pass



ac40	5310	Ant1	5350.6	-37.17	2.35	61.78	Peak	68.2	Pass
ac40	5310	Ant1	5351	-47.05	2.35	51.9	Average	54	Pass
ac40	5310	Ant1	5460	-40.76	2.35	58.19	Peak	68.2	Pass
ac40	5310	Ant1	5460	-49.72	2.35	49.23	Average	54	Pass
ac40	5510	Ant1	5460	-41.15	2.35	57.8	Peak	68.2	Pass
ac40	5510	Ant1	5460	-48	2.35	50.95	Average	54	Pass
ac40	5510	Ant1	5465.6	-38.03	2.35	60.92	Peak	68.2	Pass
ac40	5510	Ant1	-46.82	-46.82	2.35	52.13	Average	54	Pass
ac40	5510	Ant1	5470	-42.26	2.35	56.69	Peak	68.2	Pass
ac40	5510	Ant1	5470	-48.48	2.35	50.47	Average	54	Pass
ac40	5670	Ant1	5725	-41.55	2.35	57.4	Peak	68.2	Pass
ac40	5670	Ant1	5725	-47.09	2.35	51.86	Average	54	Pass
ac40	5670	Ant1	5726	-38.1	2.35	60.85	Peak	68.2	Pass
ac40	5670	Ant1	5728.4	-45.63	2.35	53.32	Average	54	Pass
ac40	5670	Ant1	-41.28	-41.28	2.35	57.67	Peak	68.2	Pass
ac40	5670	Ant1	5735	-48.04	2.35	50.91	Average	54	Pass
ac80	5210	Ant1	4500	-41.95	2.35	57	Peak	68.2	Pass
ac80	5210	Ant1	4500	-50.46	2.35	48.49	Average	54	Pass
ac80	5210	Ant1	5135.16	-36.85	2.35	62.1	Peak	68.2	Pass
ac80	5210	Ant1	5138.32	-45.8	2.35	53.15	Average	54	Pass
ac80	5210	Ant1	5150	-36.75	2.35	62.2	Peak	68.2	Pass
ac80	5210	Ant1	5150	-46.5	2.35	52.45	Average	54	Pass
ac80	5290	Ant1	4500	-42.66	2.35	56.29	Peak	68.2	Pass
ac80	5290	Ant1	4500	-50.68	2.35	48.27	Average	54	Pass
ac80	5290	Ant1	4945.44	-38.76	2.35	60.19	Peak	68.2	Pass
ac80	5290	Ant1	4895.85	-48.12	2.35	50.83	Average	54	Pass
ac80	5290	Ant1	5150	-41.89	2.35	57.06	Peak	68.2	Pass
ac80	5290	Ant1	5150	-49.35	2.35	49.6	Average	54	Pass
ac80	5530	Ant1	5460	-40.29	2.35	58.66	Peak	68.2	Pass
ac80	5530	Ant1	5460	-47.45	2.35	51.5	Average	54	Pass
ac80	5530	Ant1	5464.4	-36.22	2.35	62.73	Peak	68.2	Pass
ac80	5530	Ant1	5468	-45.17	2.35	53.78	Average	54	Pass
ac80	5530	Ant1	5470	-37.83	2.35	61.12	Peak	68.2	Pass
ac80	5530	Ant1	5470	-46.53	2.35	52.42	Average	54	Pass
ac80	5610	Ant1	5725	-40.16	2.35	58.79	Peak	68.2	Pass
ac80	5610	Ant1	5725	-49.2	2.35	49.75	Average	54	Pass
ac80	5610	Ant1	5735	-39.8	2.35	59.15	Peak	68.2	Pass
ac80	5610	Ant1	5733.155	-47.66	2.35	51.29	Average	54	Pass
ac80	5610	Ant1	5735	-39.8	2.35	59.15	Peak	68.2	Pass
ac80	5610	Ant1	5735	-48.73	2.35	50.22	Average	54	Pass
ax20	5180	Ant1	4500	-42.15	2.35	56.8	Peak	68.2	Pass
ax20	5180	Ant1	4500	-50.65	2.35	48.3	Average	54	Pass
ax20	5180	Ant1	5143.3	-38.62	2.35	60.33	Peak	68.2	Pass



ax20	5180	Ant1	4965.5	-48.11	2.35	50.84	Average	54	Pass
ax20	5180	Ant1	5150	-41.37	2.35	57.58	Peak	68.2	Pass
ax20	5180	Ant1	5150	-49.3	2.35	49.65	Average	54	Pass
ax20	5240	Ant1	5350	-43.65	2.35	55.3	Peak	68.2	Pass
ax20	5240	Ant1	5350	-50.16	2.35	48.79	Average	54	Pass
ax20	5240	Ant1	5450.4	-39.3	2.35	59.65	Peak	68.2	Pass
ax20	5240	Ant1	5447.76	-48.23	2.35	50.72	Average	54	Pass
ax20	5240	Ant1	5460	-41.72	2.35	57.23	Peak	68.2	Pass
ax20	5240	Ant1	5460	-50.09	2.35	48.86	Average	54	Pass
ax20	5260	Ant1	4500	-43.09	2.35	55.86	Peak	68.2	Pass
ax20	5260	Ant1	4500	-51.37	2.35	47.58	Average	54	Pass
ax20	5260	Ant1	5141.94	-39.21	2.35	59.74	Peak	68.2	Pass
ax20	5260	Ant1	5028.06	-48.46	2.35	50.49	Average	54	Pass
ax20	5260	Ant1	5150	-42.39	2.35	56.56	Peak	68.2	Pass
ax20	5260	Ant1	5150	-50.44	2.35	48.51	Average	54	Pass
ax20	5320	Ant1	5350	-41.89	2.35	57.06	Peak	68.2	Pass
ax20	5320	Ant1	5350	-49.76	2.35	49.19	Average	54	Pass
ax20	5320	Ant1	5458.8	-39.15	2.35	59.8	Peak	68.2	Pass
ax20	5320	Ant1	5449.8	-47.78	2.35	51.17	Average	54	Pass
ax20	5320	Ant1	5460	-42.81	2.35	56.14	Peak	68.2	Pass
ax20	5320	Ant1	5460	-50.11	2.35	48.84	Average	54	Pass
ax20	5500	Ant1	5460	-40.3	2.35	58.65	Peak	68.2	Pass
ax20	5500	Ant1	5460	-48.25	2.35	50.7	Average	54	Pass
ax20	5500	Ant1	5463.6	-38.49	2.35	60.46	Peak	68.2	Pass
ax20	5500	Ant1	5465.4	-48.16	2.35	50.79	Average	54	Pass
ax20	5500	Ant1	5470	-40.96	2.35	57.99	Peak	68.2	Pass
ax20	5500	Ant1	5470	-48.9	2.35	50.05	Average	54	Pass
ax20	5700	Ant1	5725	-40.72	2.35	58.23	Peak	68.2	Pass
ax20	5700	Ant1	5725	-48.82	2.35	50.13	Average	54	Pass
ax20	5700	Ant1	5725.6	-38.07	2.35	60.88	Peak	68.2	Pass
ax20	5700	Ant1	5727.4	-47.61	2.35	51.34	Average	54	Pass
ax20	5700	Ant1	5735	-40.97	2.35	57.98	Peak	68.2	Pass
ax20	5700	Ant1	5735	-48.7	2.35	50.25	Average	54	Pass
ax40	5190	Ant1	4500	-40.69	2.35	58.26	Peak	68.2	Pass
ax40	5190	Ant1	4500	-51.07	2.35	47.88	Average	54	Pass
ax40	5190	Ant1	4981.07	-38.33	2.35	60.62	Peak	68.2	Pass
ax40	5190	Ant1	4965.01	-48.08	2.35	50.87	Average	54	Pass
ax40	5190	Ant1	5150	-40.22	2.35	58.73	Peak	68.2	Pass
ax40	5190	Ant1	5150	-48.42	2.35	50.53	Average	54	Pass
ax40	5230	Ant1	5350	-42.72	2.35	56.23	Peak	68.2	Pass
ax40	5230	Ant1	5350	-49.99	2.35	48.96	Average	54	Pass
ax40	5230	Ant1	5427.06	-38.93	2.35	60.02	Peak	68.2	Pass
ax40	5230	Ant1	5449.74	-48.16	2.35	50.79	Average	54	Pass



ax40	5230	Ant1	5460	-41.9	2.35	57.05	Peak	68.2	Pass
ax40	5230	Ant1	5460	-50.09	2.35	48.86	Average	54	Pass
ax40	5270	Ant1	4500	-42.95	2.35	56	Peak	68.2	Pass
ax40	5270	Ant1	4500	-50.96	2.35	47.99	Average	54	Pass
ax40	5270	Ant1	4994.91	-39.35	2.35	59.6	Peak	68.2	Pass
ax40	5270	Ant1	4962.51	-47.43	2.35	51.52	Average	54	Pass
ax40	5270	Ant1	5150	-41.71	2.35	57.24	Peak	68.2	Pass
ax40	5270	Ant1	5150	-50.29	2.35	48.66	Average	54	Pass
ax40	5310	Ant1	5350	-43.73	2.35	55.22	Peak	68.2	Pass
ax40	5310	Ant1	5350	-49.58	2.35	49.37	Average	54	Pass
ax40	5310	Ant1	5377.6	-39.36	2.35	59.59	Peak	68.2	Pass
ax40	5310	Ant1	5356.8	-48.68	2.35	50.27	Average	54	Pass
ax40	5310	Ant1	5460	-43.17	2.35	55.78	Peak	68.2	Pass
ax40	5310	Ant1	5460	-49.71	2.35	49.24	Average	54	Pass
ax40	5510	Ant1	5460	-42.04	2.35	56.91	Peak	68.2	Pass
ax40	5510	Ant1	5460	-48.62	2.35	50.33	Average	54	Pass
ax40	5510	Ant1	5469.2	-37.78	2.35	61.17	Peak	68.2	Pass
ax40	5510	Ant1	-48.34	-48.34	2.35	50.61	Average	54	Pass
ax40	5510	Ant1	5470	-40.61	2.35	58.34	Peak	68.2	Pass
ax40	5510	Ant1	5470	-49.28	2.35	49.67	Average	54	Pass
ax40	5670	Ant1	5725	-38.76	2.35	60.19	Peak	68.2	Pass
ax40	5670	Ant1	5725	-48.55	2.35	50.4	Average	54	Pass
ax40	5670	Ant1	5727	-38.02	2.35	60.93	Peak	68.2	Pass
ax40	5670	Ant1	5726.4	-47.66	2.35	51.29	Average	54	Pass
ax40	5670	Ant1	-41.53	-41.53	2.35	57.42	Peak	68.2	Pass
ax40	5670	Ant1	5735	-48.63	2.35	50.32	Average	54	Pass
ax80	5210	Ant1	4500	-42.12	2.35	56.83	Peak	68.2	Pass
ax80	5210	Ant1	4500	-50.65	2.35	48.3	Average	54	Pass
ax80	5210	Ant1	5128.05	-37.97	2.35	60.98	Peak	68.2	Pass
ax80	5210	Ant1	5147.01	-46.07	2.35	52.88	Average	54	Pass
ax80	5210	Ant1	5150	-39.56	2.35	59.39	Peak	68.2	Pass
ax80	5210	Ant1	5150	-46.75	2.35	52.2	Average	54	Pass
ax80	5290	Ant1	4500	-41.61	2.35	57.34	Peak	68.2	Pass
ax80	5290	Ant1	4500	-50.81	2.35	48.14	Average	54	Pass
ax80	5290	Ant1	4998.51	-38.25	2.35	60.7	Peak	68.2	Pass
ax80	5290	Ant1	4963.71	-47.46	2.35	51.49	Average	54	Pass
ax80	5290	Ant1	5150	-42.45	2.35	56.5	Peak	68.2	Pass
ax80	5290	Ant1	5150	-48.65	2.35	50.3	Average	54	Pass
ax80	5530	Ant1	5460	-40.42	2.35	58.53	Peak	68.2	Pass
ax80	5530	Ant1	5460	-47.84	2.35	51.11	Average	54	Pass
ax80	5530	Ant1	5463.8	-37.22	2.35	61.73	Peak	68.2	Pass
ax80	5530	Ant1	5461.6	-46.49	2.35	52.46	Average	54	Pass
ax80	5530	Ant1	5470	-40.49	2.35	58.46	Peak	68.2	Pass



ax80	5530	Ant1	5470	-46.99	2.35	51.96	Average	54	Pass
ax80	5610	Ant1	5725	-42.1	2.35	56.85	Peak	68.2	Pass
ax80	5610	Ant1	5725	-48.78	2.35	50.17	Average	54	Pass
ax80	5610	Ant1	5727.005	-39.62	2.35	59.33	Peak	68.2	Pass
ax80	5610	Ant1	5727.415	-47.69	2.35	51.26	Average	54	Pass
ax80	5610	Ant1	5735	-41.95	2.35	57	Peak	68.2	Pass
ax80	5610	Ant1	5735	-49.05	2.35	49.9	Average	54	Pass
a	5180	Ant2	4500	-42.22	1.39	56.87	Peak	68.2	Pass
a	5180	Ant2	4500	-51.92	1.39	47.17	Average	54	Pass
a	5180	Ant2	5149.6	-31.28	1.39	67.81	Peak	68.2	Pass
a	5180	Ant2	5148.2	-47.94	1.39	51.15	Average	54	Pass
a	5180	Ant2	5150	-38.4	1.39	60.69	Peak	68.2	Pass
a	5180	Ant2	5150	-47.97	1.39	51.12	Average	54	Pass
a	5240	Ant2	5350	-40.67	1.39	58.42	Peak	68.2	Pass
a	5240	Ant2	5350	-49.85	1.39	49.24	Average	54	Pass
a	5240	Ant2	5364.48	-38.06	1.39	61.03	Peak	68.2	Pass
a	5240	Ant2	5446.8	-48.65	1.39	50.44	Average	54	Pass
a	5240	Ant2	5460	-42.41	1.39	56.68	Peak	68.2	Pass
a	5240	Ant2	5460	-50.38	1.39	48.71	Average	54	Pass
a	5260	Ant2	4500	-42.7	1.39	56.39	Peak	68.2	Pass
a	5260	Ant2	4500	-51.73	1.39	47.36	Average	54	Pass
a	5260	Ant2	5007.78	-38.62	1.39	60.47	Peak	68.2	Pass
a	5260	Ant2	5027.28	-49.27	1.39	49.82	Average	54	Pass
a	5260	Ant2	5150	-39.89	1.39	59.2	Peak	68.2	Pass
a	5260	Ant2	5150	-50.45	1.39	48.64	Average	54	Pass
a	5320	Ant2	5350	-38.67	1.39	60.42	Peak	68.2	Pass
a	5320	Ant2	5350	-47.78	1.39	51.31	Average	54	Pass
a	5320	Ant2	5361.8	-36.74	1.39	62.35	Peak	68.2	Pass
a	5320	Ant2	5351.2	-47.57	1.39	51.52	Average	54	Pass
a	5320	Ant2	5460	-42.35	1.39	56.74	Peak	68.2	Pass
a	5320	Ant2	5460	-49.69	1.39	49.4	Average	54	Pass
a	5500	Ant2	5460	-36.57	1.39	62.52	Peak	68.2	Pass
a	5500	Ant2	5460	-45.77	1.39	53.32	Average	54	Pass
a	5500	Ant2	5470	-32.9	1.39	66.19	Peak	68.2	Pass
a	5500	Ant2	5469.6	-45.37	1.39	53.72	Average	54	Pass
a	5500	Ant2	5470	-32.9	1.39	66.19	Peak	68.2	Pass
a	5500	Ant2	5470	-45.54	1.39	53.55	Average	54	Pass
a	5700	Ant2	5725	-35.82	1.39	63.27	Peak	68.2	Pass
a	5700	Ant2	5725	-46.76	1.39	52.33	Average	54	Pass
a	5700	Ant2	5725	-35.82	1.39	63.27	Peak	68.2	Pass
a	5700	Ant2	5725	-46.76	1.39	52.33	Average	54	Pass
a	5700	Ant2	5735	-37.81	1.39	61.28	Peak	68.2	Pass
a	5700	Ant2	5735	-47.32	1.39	51.77	Average	54	Pass



n20	5180	Ant2	4500	-41.34	1.39	57.75	Peak	68.2	Pass
n20	5180	Ant2	4500	-51.86	1.39	47.23	Average	54	Pass
n20	5180	Ant2	5147.5	-36.68	1.39	62.41	Peak	68.2	Pass
n20	5180	Ant2	5149.6	-48.55	1.39	50.54	Average	54	Pass
n20	5180	Ant2	5150	-38.37	1.39	60.72	Peak	68.2	Pass
n20	5180	Ant2	5150	-48.58	1.39	50.51	Average	54	Pass
n20	5240	Ant2	5350	-42.21	1.39	56.88	Peak	68.2	Pass
n20	5240	Ant2	5350	-50.46	1.39	48.63	Average	54	Pass
n20	5240	Ant2	5440.56	-38.52	1.39	60.57	Peak	68.2	Pass
n20	5240	Ant2	5447.04	-48.98	1.39	50.11	Average	54	Pass
n20	5240	Ant2	5460	-41.3	1.39	57.79	Peak	68.2	Pass
n20	5240	Ant2	5460	-50.27	1.39	48.82	Average	54	Pass
n20	5260	Ant2	4500	-41.98	1.39	57.11	Peak	68.2	Pass
n20	5260	Ant2	4500	-51.45	1.39	47.64	Average	54	Pass
n20	5260	Ant2	4975.02	-38.68	1.39	60.41	Peak	68.2	Pass
n20	5260	Ant2	4899.36	-49.41	1.39	49.68	Average	54	Pass
n20	5260	Ant2	5150	-40.4	1.39	58.69	Peak	68.2	Pass
n20	5260	Ant2	5150	-50.7	1.39	48.39	Average	54	Pass
n20	5320	Ant2	5350	-38.64	1.39	60.45	Peak	68.2	Pass
n20	5320	Ant2	5350	-47.62	1.39	51.47	Average	54	Pass
n20	5320	Ant2	5386.4	-37.73	1.39	61.36	Peak	68.2	Pass
n20	5320	Ant2	5350.6	-47.54	1.39	51.55	Average	54	Pass
n20	5320	Ant2	5460	-41.97	1.39	57.12	Peak	68.2	Pass
n20	5320	Ant2	5460	-49.78	1.39	49.31	Average	54	Pass
n20	5500	Ant2	5460	-36.56	1.39	62.53	Peak	68.2	Pass
n20	5500	Ant2	5460	-46.41	1.39	52.68	Average	54	Pass
n20	5500	Ant2	5467.2	-35.67	1.39	63.42	Peak	68.2	Pass
n20	5500	Ant2	5460	-46.41	1.39	52.68	Average	54	Pass
n20	5500	Ant2	5470	-37.76	1.39	61.33	Peak	68.2	Pass
n20	5500	Ant2	5470	-46.7	1.39	52.39	Average	54	Pass
n20	5700	Ant2	5725	-37.4	1.39	61.69	Peak	68.2	Pass
n20	5700	Ant2	5725	-47.07	1.39	52.02	Average	54	Pass
n20	5700	Ant2	5725.4	-36.9	1.39	62.19	Peak	68.2	Pass
n20	5700	Ant2	5727.2	-46.94	1.39	52.15	Average	54	Pass
n20	5700	Ant2	5735	-37.76	1.39	61.33	Peak	68.2	Pass
n20	5700	Ant2	5735	-47.74	1.39	51.35	Average	54	Pass
n40	5190	Ant2	4500	-40.92	1.39	58.17	Peak	68.2	Pass
n40	5190	Ant2	4500	-50.78	1.39	48.31	Average	54	Pass
n40	5190	Ant2	5146.05	-37.84	1.39	61.25	Peak	68.2	Pass
n40	5190	Ant2	5147.51	-47.02	1.39	52.07	Average	54	Pass
n40	5190	Ant2	5150	-39.2	1.39	59.89	Peak	68.2	Pass
n40	5190	Ant2	5150	-47.81	1.39	51.28	Average	54	Pass
n40	5230	Ant2	5350	-41.67	1.39	57.42	Peak	68.2	Pass



n40	5230	Ant2	5350	-49.61	1.39	49.48	Average	54	Pass
n40	5230	Ant2	5437.86	-38.92	1.39	60.17	Peak	68.2	Pass
n40	5230	Ant2	5451.09	-46.88	1.39	52.21	Average	54	Pass
n40	5230	Ant2	5460	-42.73	1.39	56.36	Peak	68.2	Pass
n40	5230	Ant2	5460	-49.69	1.39	49.4	Average	54	Pass
n40	5270	Ant2	4500	-42.03	1.39	57.06	Peak	68.2	Pass
n40	5270	Ant2	4500	-50.27	1.39	48.82	Average	54	Pass
n40	5270	Ant2	5010.3	-38.64	1.39	60.45	Peak	68.2	Pass
n40	5270	Ant2	4851.54	-47.29	1.39	51.8	Average	54	Pass
n40	5270	Ant2	5150	-40.42	1.39	58.67	Peak	68.2	Pass
n40	5270	Ant2	5150	-49.04	1.39	50.05	Average	54	Pass
n40	5310	Ant2	5350	-39.6	1.39	59.49	Peak	68.2	Pass
n40	5310	Ant2	5350	-47.78	1.39	51.31	Average	54	Pass
n40	5310	Ant2	5356.4	-34.66	1.39	64.43	Peak	68.2	Pass
n40	5310	Ant2	5371.6	-46.98	1.39	52.11	Average	54	Pass
n40	5310	Ant2	5460	-40.3	1.39	58.79	Peak	68.2	Pass
n40	5310	Ant2	5460	-48.75	1.39	50.34	Average	54	Pass
n40	5510	Ant2	5460	-37.53	1.39	61.56	Peak	68.2	Pass
n40	5510	Ant2	5460	-47.39	1.39	51.7	Average	54	Pass
n40	5510	Ant2	5467	-36.62	1.39	62.47	Peak	68.2	Pass
n40	5510	Ant2	-45.59	-45.59	1.39	53.5	Average	54	Pass
n40	5510	Ant2	5470	-40.18	1.39	58.91	Peak	68.2	Pass
n40	5510	Ant2	5470	-47.19	1.39	51.9	Average	54	Pass
n40	5670	Ant2	5725	-38.65	1.39	60.44	Peak	68.2	Pass
n40	5670	Ant2	5725	-47.45	1.39	51.64	Average	54	Pass
n40	5670	Ant2	5732.6	-36.52	1.39	62.57	Peak	68.2	Pass
n40	5670	Ant2	5729.4	-46.46	1.39	52.63	Average	54	Pass
n40	5670	Ant2	-40.35	-40.35	1.39	58.74	Peak	68.2	Pass
n40	5670	Ant2	5735	-47.67	1.39	51.42	Average	54	Pass
ac20	5180	Ant2	4500	-43.21	1.39	55.88	Peak	68.2	Pass
ac20	5180	Ant2	4500	-51.84	1.39	47.25	Average	54	Pass
ac20	5180	Ant2	5118.1	-37.61	1.39	61.48	Peak	68.2	Pass
ac20	5180	Ant2	5148.2	-48.95	1.39	50.14	Average	54	Pass
ac20	5180	Ant2	5150	-38.93	1.39	60.16	Peak	68.2	Pass
ac20	5180	Ant2	5150	-49.04	1.39	50.05	Average	54	Pass
ac20	5240	Ant2	5350	-40.29	1.39	58.8	Peak	68.2	Pass
ac20	5240	Ant2	5350	-50.18	1.39	48.91	Average	54	Pass
ac20	5240	Ant2	5357.04	-38.39	1.39	60.7	Peak	68.2	Pass
ac20	5240	Ant2	5447.04	-48.34	1.39	50.75	Average	54	Pass
ac20	5240	Ant2	5460	-41.89	1.39	57.2	Peak	68.2	Pass
ac20	5240	Ant2	5460	-50.18	1.39	48.91	Average	54	Pass
ac20	5260	Ant2	4500	-41.59	1.39	57.5	Peak	68.2	Pass
ac20	5260	Ant2	4500	-51.59	1.39	47.5	Average	54	Pass



ac20	5260	Ant2	5071.74	-38.27	1.39	60.82	Peak	68.2	Pass
ac20	5260	Ant2	5028.06	-48.83	1.39	50.26	Average	54	Pass
ac20	5260	Ant2	5150	-41.26	1.39	57.83	Peak	68.2	Pass
ac20	5260	Ant2	5150	-50.33	1.39	48.76	Average	54	Pass
ac20	5320	Ant2	5350	-40.32	1.39	58.77	Peak	68.2	Pass
ac20	5320	Ant2	5350	-47.72	1.39	51.37	Average	54	Pass
ac20	5320	Ant2	5355.8	-35.82	1.39	63.27	Peak	68.2	Pass
ac20	5320	Ant2	5447.4	-47.29	1.39	51.8	Average	54	Pass
ac20	5320	Ant2	5460	-42.72	1.39	56.37	Peak	68.2	Pass
ac20	5320	Ant2	5460	-49.57	1.39	49.52	Average	54	Pass
ac20	5500	Ant2	5460	-36.21	1.39	62.88	Peak	68.2	Pass
ac20	5500	Ant2	5460	-45.74	1.39	53.35	Average	54	Pass
ac20	5500	Ant2	5470	-35.25	1.39	63.84	Peak	68.2	Pass
ac20	5500	Ant2	5465	-45.32	1.39	53.77	Average	54	Pass
ac20	5500	Ant2	5470	-35.25	1.39	63.84	Peak	68.2	Pass
ac20	5500	Ant2	5470	-45.45	1.39	53.64	Average	54	Pass
ac20	5700	Ant2	5725	-35.75	1.39	63.34	Peak	68.2	Pass
ac20	5700	Ant2	5725	-45.81	1.39	53.28	Average	54	Pass
ac20	5700	Ant2	5725	-35.75	1.39	63.34	Peak	68.2	Pass
ac20	5700	Ant2	5725.8	-45.72	1.39	53.37	Average	54	Pass
ac20	5700	Ant2	5735	-38.48	1.39	60.61	Peak	68.2	Pass
ac20	5700	Ant2	5735	-46.93	1.39	52.16	Average	54	Pass
ac40	5190	Ant2	4500	-42.11	1.39	56.98	Peak	68.2	Pass
ac40	5190	Ant2	4500	-50.5	1.39	48.59	Average	54	Pass
ac40	5190	Ant2	5010.27	-38.43	1.39	60.66	Peak	68.2	Pass
ac40	5190	Ant2	4894.93	-47.83	1.39	51.26	Average	54	Pass
ac40	5190	Ant2	5150	-40.31	1.39	58.78	Peak	68.2	Pass
ac40	5190	Ant2	5150	-48.73	1.39	50.36	Average	54	Pass
ac40	5230	Ant2	5350	-43.2	1.39	55.89	Peak	68.2	Pass
ac40	5230	Ant2	5350	-49.55	1.39	49.54	Average	54	Pass
ac40	5230	Ant2	5453.52	-38.92	1.39	60.17	Peak	68.2	Pass
ac40	5230	Ant2	5452.17	-46.76	1.39	52.33	Average	54	Pass
ac40	5230	Ant2	5460	-41.27	1.39	57.82	Peak	68.2	Pass
ac40	5230	Ant2	5460	-49.63	1.39	49.46	Average	54	Pass
ac40	5270	Ant2	4500	-42.37	1.39	56.72	Peak	68.2	Pass
ac40	5270	Ant2	4500	-50.16	1.39	48.93	Average	54	Pass
ac40	5270	Ant2	4971.42	-38.51	1.39	60.58	Peak	68.2	Pass
ac40	5270	Ant2	4966.56	-47.05	1.39	52.04	Average	54	Pass
ac40	5270	Ant2	5150	-40.42	1.39	58.67	Peak	68.2	Pass
ac40	5270	Ant2	5150	-49.01	1.39	50.08	Average	54	Pass
ac40	5310	Ant2	5350	-39.7	1.39	59.39	Peak	68.2	Pass
ac40	5310	Ant2	5350	-48.17	1.39	50.92	Average	54	Pass
ac40	5310	Ant2	5433.4	-37.31	1.39	61.78	Peak	68.2	Pass



ac40	5310	Ant2	5356.6	-46.79	1.39	52.3	Average	54	Pass
ac40	5310	Ant2	5460	-41.11	1.39	57.98	Peak	68.2	Pass
ac40	5310	Ant2	5460	-48.9	1.39	50.19	Average	54	Pass
ac40	5510	Ant2	5460	-38.83	1.39	60.26	Peak	68.2	Pass
ac40	5510	Ant2	5460	-46.97	1.39	52.12	Average	54	Pass
ac40	5510	Ant2	5468	-36.18	1.39	62.91	Peak	68.2	Pass
ac40	5510	Ant2	-45.8	-45.8	1.39	53.29	Average	54	Pass
ac40	5510	Ant2	5470	-37.96	1.39	61.13	Peak	68.2	Pass
ac40	5510	Ant2	5470	-46.91	1.39	52.18	Average	54	Pass
ac40	5670	Ant2	5725	-39.96	1.39	59.13	Peak	68.2	Pass
ac40	5670	Ant2	5725	-47.44	1.39	51.65	Average	54	Pass
ac40	5670	Ant2	5731.8	-38.72	1.39	60.37	Peak	68.2	Pass
ac40	5670	Ant2	5725.8	-46.91	1.39	52.18	Average	54	Pass
ac40	5670	Ant2	-40.66	-40.66	1.39	58.43	Peak	68.2	Pass
ac40	5670	Ant2	5735	-47.29	1.39	51.8	Average	54	Pass
ac80	5210	Ant2	4500	-41.99	1.39	57.1	Peak	68.2	Pass
ac80	5210	Ant2	4500	-50.04	1.39	49.05	Average	54	Pass
ac80	5210	Ant2	5143.85	-38.16	1.39	60.93	Peak	68.2	Pass
ac80	5210	Ant2	5143.85	-47.17	1.39	51.92	Average	54	Pass
ac80	5210	Ant2	5150	-40.96	1.39	58.13	Peak	68.2	Pass
ac80	5210	Ant2	5150	-47.23	1.39	51.86	Average	54	Pass
ac80	5290	Ant2	4500	-43.14	1.39	55.95	Peak	68.2	Pass
ac80	5290	Ant2	4500	-49.75	1.39	49.34	Average	54	Pass
ac80	5290	Ant2	4983.72	-37.6	1.39	61.49	Peak	68.2	Pass
ac80	5290	Ant2	4968.06	-47.14	1.39	51.95	Average	54	Pass
ac80	5290	Ant2	5150	-42.06	1.39	57.03	Peak	68.2	Pass
ac80	5290	Ant2	5150	-49.66	1.39	49.43	Average	54	Pass
ac80	5530	Ant2	5460	-40.65	1.39	58.44	Peak	68.2	Pass
ac80	5530	Ant2	5460	-46.61	1.39	52.48	Average	54	Pass
ac80	5530	Ant2	5468.8	-36.98	1.39	62.11	Peak	68.2	Pass
ac80	5530	Ant2	5466.2	-45.86	1.39	53.23	Average	54	Pass
ac80	5530	Ant2	5470	-40.28	1.39	58.81	Peak	68.2	Pass
ac80	5530	Ant2	5470	-46.44	1.39	52.65	Average	54	Pass
ac80	5610	Ant2	5725	-40.5	1.39	58.59	Peak	68.2	Pass
ac80	5610	Ant2	5725	-48.03	1.39	51.06	Average	54	Pass
ac80	5610	Ant2	5728.85	-38.56	1.39	60.53	Peak	68.2	Pass
ac80	5610	Ant2	5726.595	-47.22	1.39	51.87	Average	54	Pass
ac80	5610	Ant2	5735	-41.66	1.39	57.43	Peak	68.2	Pass
ac80	5610	Ant2	5735	-48.37	1.39	50.72	Average	54	Pass
ax20	5180	Ant2	4500	-43.35	1.39	55.74	Peak	68.2	Pass
ax20	5180	Ant2	4500	-51.05	1.39	48.04	Average	54	Pass
ax20	5180	Ant2	5136.3	-38.44	1.39	60.65	Peak	68.2	Pass
ax20	5180	Ant2	5033.4	-47.95	1.39	51.14	Average	54	Pass



ax20	5180	Ant2	5150	-39.94	1.39	59.15	Peak	68.2	Pass
ax20	5180	Ant2	5150	-50.08	1.39	49.01	Average	54	Pass
ax20	5240	Ant2	5350	-42.13	1.39	56.96	Peak	68.2	Pass
ax20	5240	Ant2	5350	-50.01	1.39	49.08	Average	54	Pass
ax20	5240	Ant2	5447.76	-38.35	1.39	60.74	Peak	68.2	Pass
ax20	5240	Ant2	5446.56	-48	1.39	51.09	Average	54	Pass
ax20	5240	Ant2	5460	-39.35	1.39	59.74	Peak	68.2	Pass
ax20	5240	Ant2	5460	-50.1	1.39	48.99	Average	54	Pass
ax20	5260	Ant2	4500	-39.22	1.39	59.87	Peak	68.2	Pass
ax20	5260	Ant2	4500	-50.85	1.39	48.24	Average	54	Pass
ax20	5260	Ant2	5055.36	-38.49	1.39	60.6	Peak	68.2	Pass
ax20	5260	Ant2	4898.58	-48.47	1.39	50.62	Average	54	Pass
ax20	5260	Ant2	5150	-41.7	1.39	57.39	Peak	68.2	Pass
ax20	5260	Ant2	5150	-50.39	1.39	48.7	Average	54	Pass
ax20	5320	Ant2	5350	-41.54	1.39	57.55	Peak	68.2	Pass
ax20	5320	Ant2	5350	-49.78	1.39	49.31	Average	54	Pass
ax20	5320	Ant2	5452.2	-37.05	1.39	62.04	Peak	68.2	Pass
ax20	5320	Ant2	5450.2	-47.3	1.39	51.79	Average	54	Pass
ax20	5320	Ant2	5460	-42.96	1.39	56.13	Peak	68.2	Pass
ax20	5320	Ant2	5460	-49.93	1.39	49.16	Average	54	Pass
ax20	5500	Ant2	5460	-39.41	1.39	59.68	Peak	68.2	Pass
ax20	5500	Ant2	5460	-46.88	1.39	52.21	Average	54	Pass
ax20	5500	Ant2	5465.6	-37.49	1.39	61.6	Peak	68.2	Pass
ax20	5500	Ant2	5461.2	-46.68	1.39	52.41	Average	54	Pass
ax20	5500	Ant2	5470	-39.94	1.39	59.15	Peak	68.2	Pass
ax20	5500	Ant2	5470	-48.61	1.39	50.48	Average	54	Pass
ax20	5700	Ant2	5725	-41.17	1.39	57.92	Peak	68.2	Pass
ax20	5700	Ant2	5725	-47.15	1.39	51.94	Average	54	Pass
ax20	5700	Ant2	5732.8	-38.63	1.39	60.46	Peak	68.2	Pass
ax20	5700	Ant2	5725.2	-47.07	1.39	52.02	Average	54	Pass
ax20	5700	Ant2	5735	-38.82	1.39	60.27	Peak	68.2	Pass
ax20	5700	Ant2	5735	-48.2	1.39	50.89	Average	54	Pass
ax40	5190	Ant2	4500	-42.66	1.39	56.43	Peak	68.2	Pass
ax40	5190	Ant2	4500	-51.25	1.39	47.84	Average	54	Pass
ax40	5190	Ant2	4928.51	-39.02	1.39	60.07	Peak	68.2	Pass
ax40	5190	Ant2	4964.28	-48.11	1.39	50.98	Average	54	Pass
ax40	5190	Ant2	5150	-41.63	1.39	57.46	Peak	68.2	Pass
ax40	5190	Ant2	5150	-49.61	1.39	49.48	Average	54	Pass
ax40	5230	Ant2	5350	-42.34	1.39	56.75	Peak	68.2	Pass
ax40	5230	Ant2	5350	-49.73	1.39	49.36	Average	54	Pass
ax40	5230	Ant2	5386.29	-39.33	1.39	59.76	Peak	68.2	Pass
ax40	5230	Ant2	5448.66	-48.15	1.39	50.94	Average	54	Pass
ax40	5230	Ant2	5460	-41.21	1.39	57.88	Peak	68.2	Pass




ax40	5230	Ant2	5460	-49.44	1.39	49.65	Average	54	Pass
ax40	5270	Ant2	4500	-40.98	1.39	58.11	Peak	68.2	Pass
ax40	5270	Ant2	4500	-50.42	1.39	48.67	Average	54	Pass
ax40	5270	Ant2	4971.42	-38.69	1.39	60.4	Peak	68.2	Pass
ax40	5270	Ant2	4962.51	-46.46	1.39	52.63	Average	54	Pass
ax40	5270	Ant2	5150	-41.62	1.39	57.47	Peak	68.2	Pass
ax40	5270	Ant2	5150	-49.76	1.39	49.33	Average	54	Pass
ax40	5310	Ant2	5350	-42.1	1.39	56.99	Peak	68.2	Pass
ax40	5310	Ant2	5350	-49.5	1.39	49.59	Average	54	Pass
ax40	5310	Ant2	5427	-38.56	1.39	60.53	Peak	68.2	Pass
ax40	5310	Ant2	5356.4	-47.57	1.39	51.52	Average	54	Pass
ax40	5310	Ant2	5460	-41.34	1.39	57.75	Peak	68.2	Pass
ax40	5310	Ant2	5460	-49.7	1.39	49.39	Average	54	Pass
ax40	5510	Ant2	5460	-41.81	1.39	57.28	Peak	68.2	Pass
ax40	5510	Ant2	5460	-47.58	1.39	51.51	Average	54	Pass
ax40	5510	Ant2	5469.4	-37.24	1.39	61.85	Peak	68.2	Pass
ax40	5510	Ant2	-46.51	-46.51	1.39	52.58	Average	54	Pass
ax40	5510	Ant2	5470	-41.76	1.39	57.33	Peak	68.2	Pass
ax40	5510	Ant2	5470	-47.77	1.39	51.32	Average	54	Pass
ax40	5670	Ant2	5725	-40.11	1.39	58.98	Peak	68.2	Pass
ax40	5670	Ant2	5725	-48.77	1.39	50.32	Average	54	Pass
ax40	5670	Ant2	5733.8	-38.99	1.39	60.1	Peak	68.2	Pass
ax40	5670	Ant2	5733	-48.2	1.39	50.89	Average	54	Pass
ax40	5670	Ant2	-40.87	-40.87	1.39	58.22	Peak	68.2	Pass
ax40	5670	Ant2	5735	-49.11	1.39	49.98	Average	54	Pass
ax80	5210	Ant2	4500	-42.11	1.39	56.98	Peak	68.2	Pass
ax80	5210	Ant2	4500	-50.75	1.39	48.34	Average	54	Pass
ax80	5210	Ant2	5127.26	-37.93	1.39	61.16	Peak	68.2	Pass
ax80	5210	Ant2	4970.05	-46.99	1.39	52.1	Average	54	Pass
ax80	5210	Ant2	5150	-40.33	1.39	58.76	Peak	68.2	Pass
ax80	5210	Ant2	5150	-48.02	1.39	51.07	Average	54	Pass
ax80	5290	Ant2	4500	-42.63	1.39	56.46	Peak	68.2	Pass
ax80	5290	Ant2	4500	-50.02	1.39	49.07	Average	54	Pass
ax80	5290	Ant2	5034.18	-38.29	1.39	60.8	Peak	68.2	Pass
ax80	5290	Ant2	4895.85	-47.22	1.39	51.87	Average	54	Pass
ax80	5290	Ant2	5150	-42.08	1.39	57.01	Peak	68.2	Pass
ax80	5290	Ant2	5150	-49.01	1.39	50.08	Average	54	Pass
ax80	5530	Ant2	5460	-43.24	1.39	55.85	Peak	68.2	Pass
ax80	5530	Ant2	5460	-47.91	1.39	51.18	Average	54	Pass
ax80	5530	Ant2	5465.4	-38.96	1.39	60.13	Peak	68.2	Pass
ax80	5530	Ant2	5465.2	-46.56	1.39	52.53	Average	54	Pass
ax80	5530	Ant2	5470	-40.31	1.39	58.78	Peak	68.2	Pass
ax80	5530	Ant2	5470	-47.26	1.39	51.83	Average	54	Pass




ax80	5610	Ant2	5725	-40.88	1.39	58.21	Peak	68.2	Pass
ax80	5610	Ant2	5725	-48.53	1.39	50.56	Average	54	Pass
ax80	5610	Ant2	5732.95	-38.62	1.39	60.47	Peak	68.2	Pass
ax80	5610	Ant2	5726.39	-47.84	1.39	51.25	Average	54	Pass
ax80	5610	Ant2	5735	-41.13	1.39	57.96	Peak	68.2	Pass
ax80	5610	Ant2	5735	-48.91	1.39	50.18	Average	54	Pass


8.2 Test Graphs

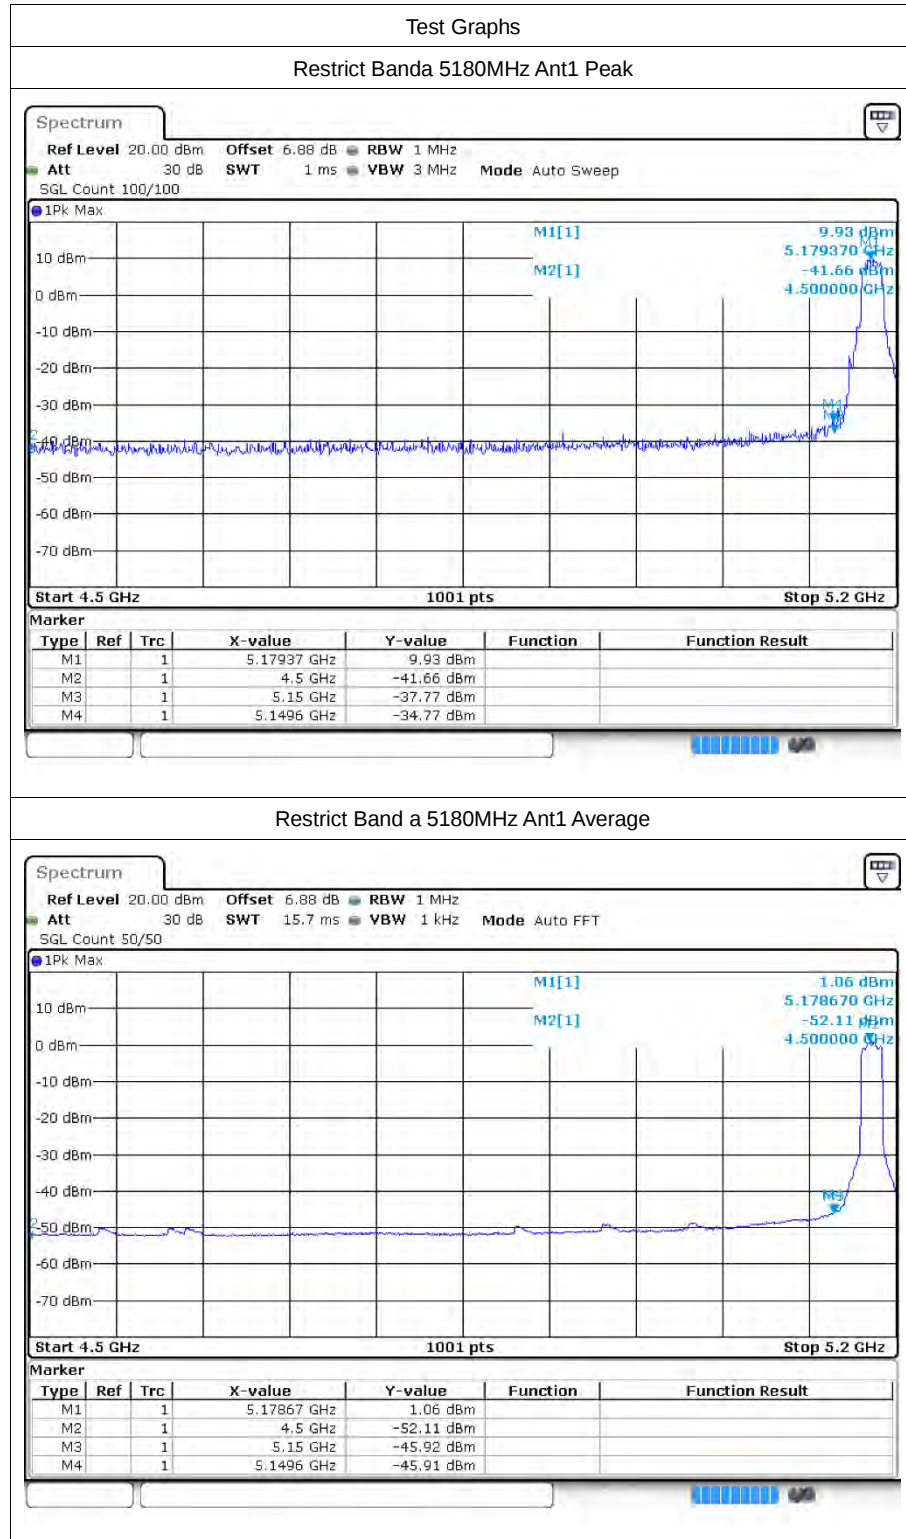


Restrict Banda 5240MHz Ant1 Peak

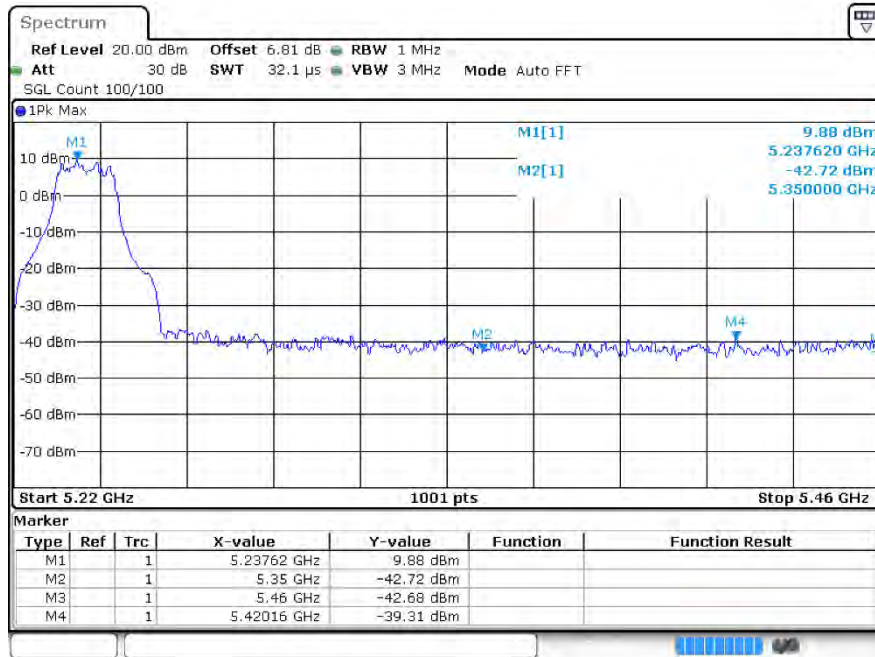


Restrict Band a 5240MHz Ant1 Average

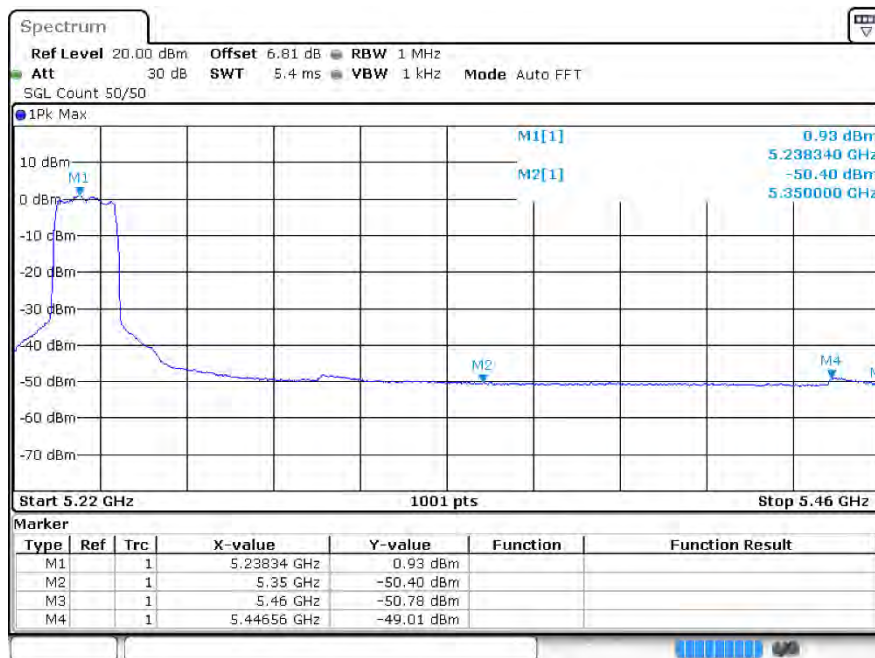


Restrict Banda 5260MHz Ant1 Peak

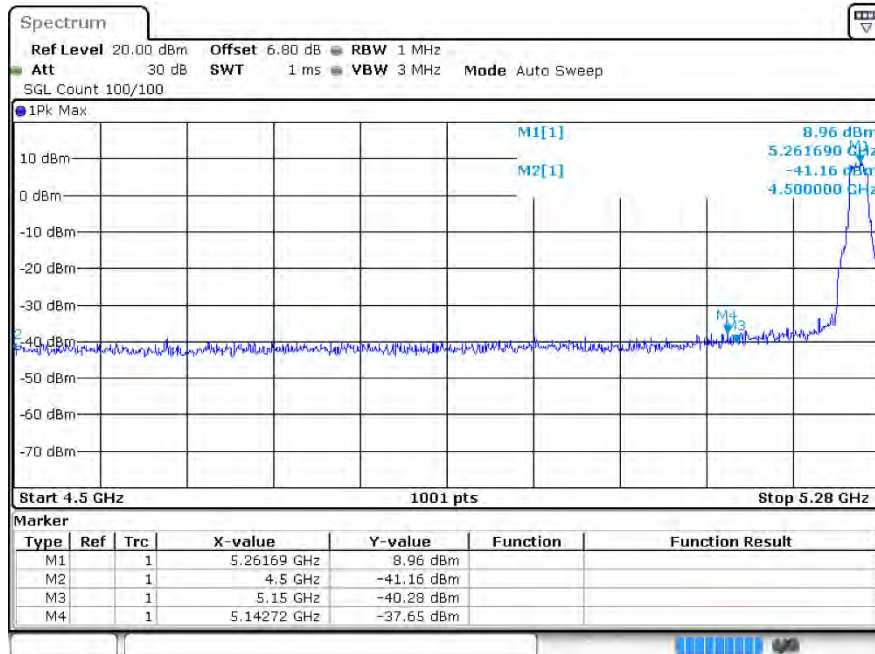


Restrict Band a 5260MHz Ant1 Average

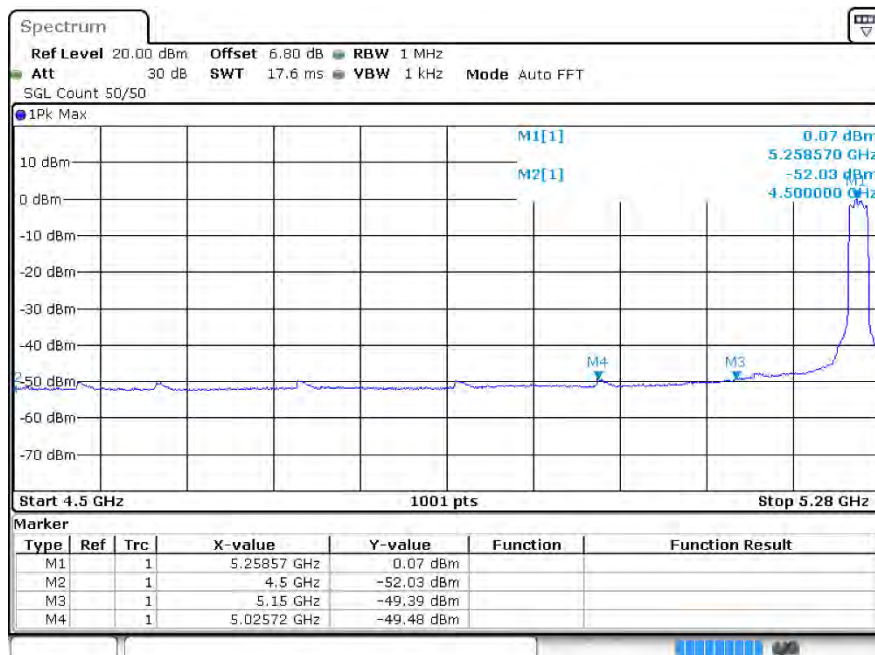


Restrict Banda 5320MHz Ant1 Peak

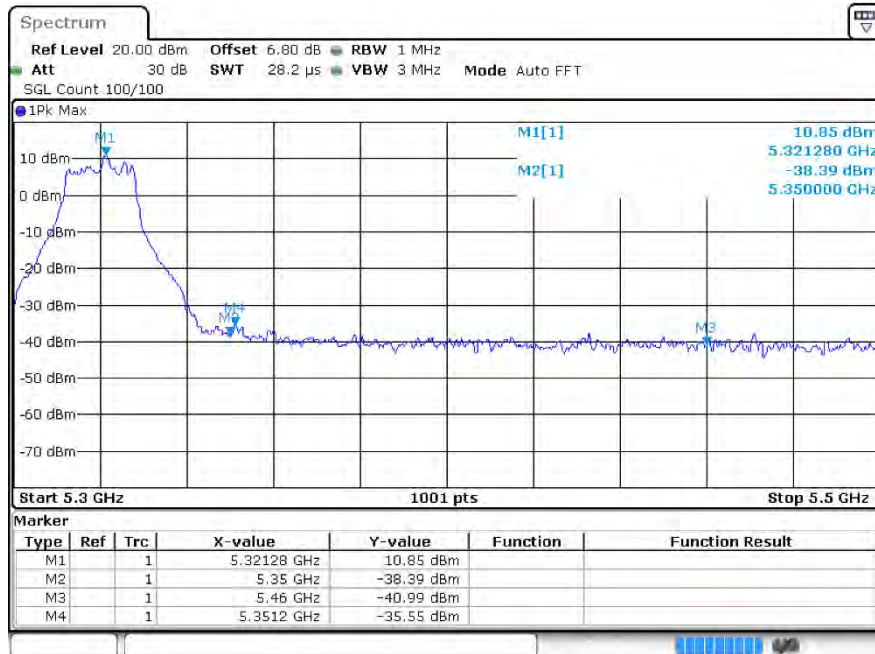


Restrict Band a 5320MHz Ant1 Average

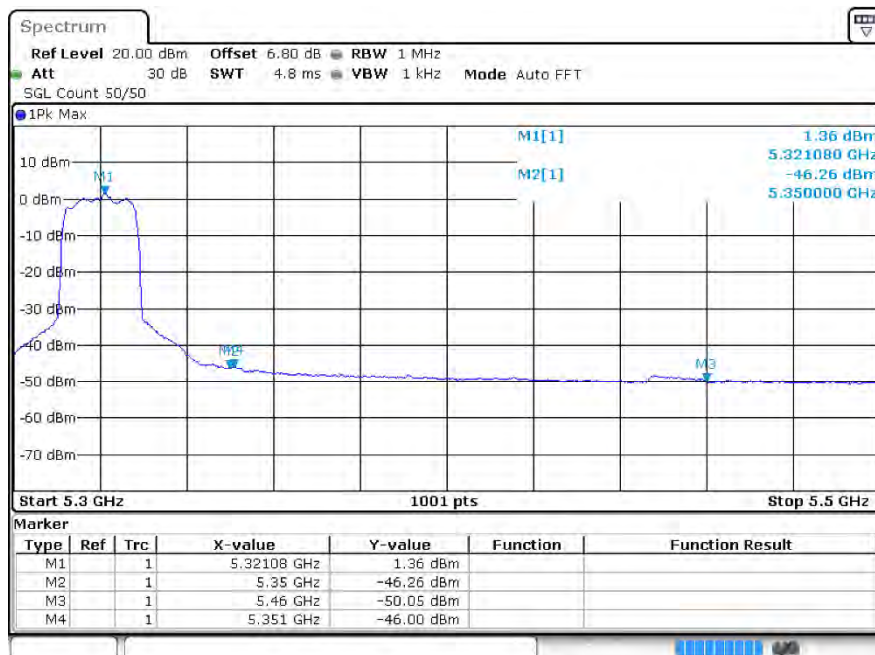


Restrict Banda 5500MHz Ant1 Peak

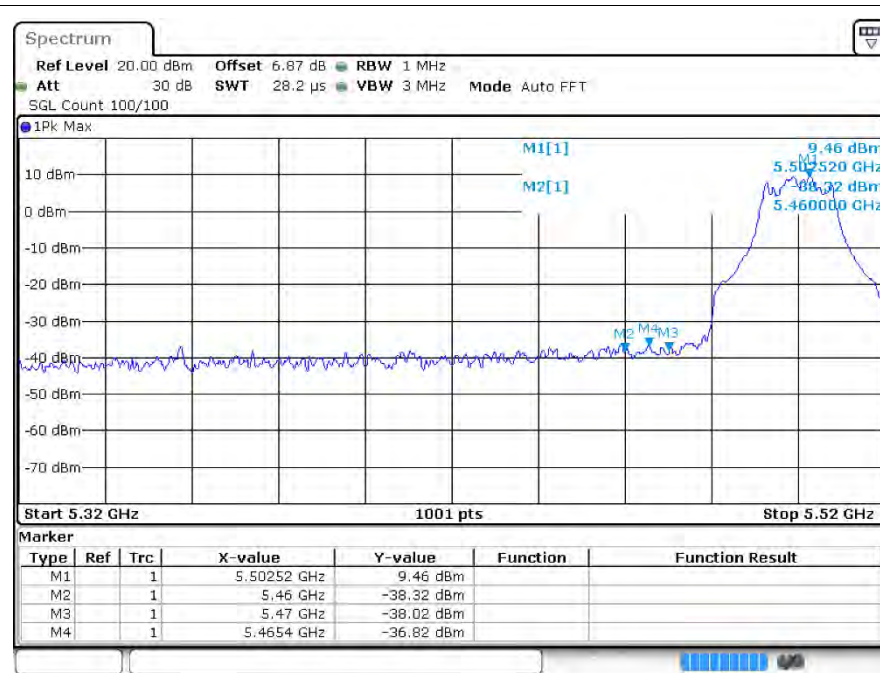


Restrict Band a 5500MHz Ant1 Average

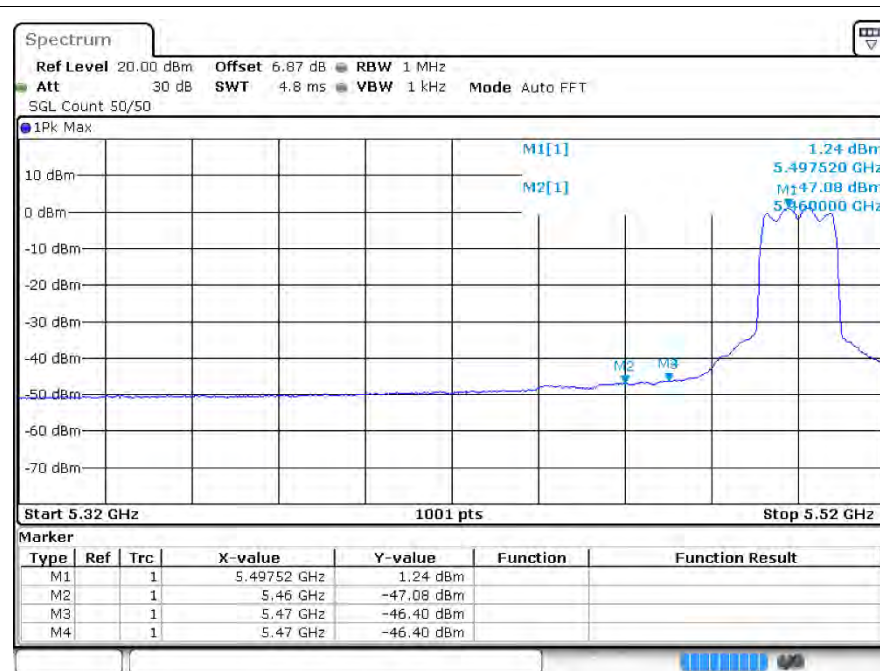


Restrict Banda 5700MHz Ant1 Peak

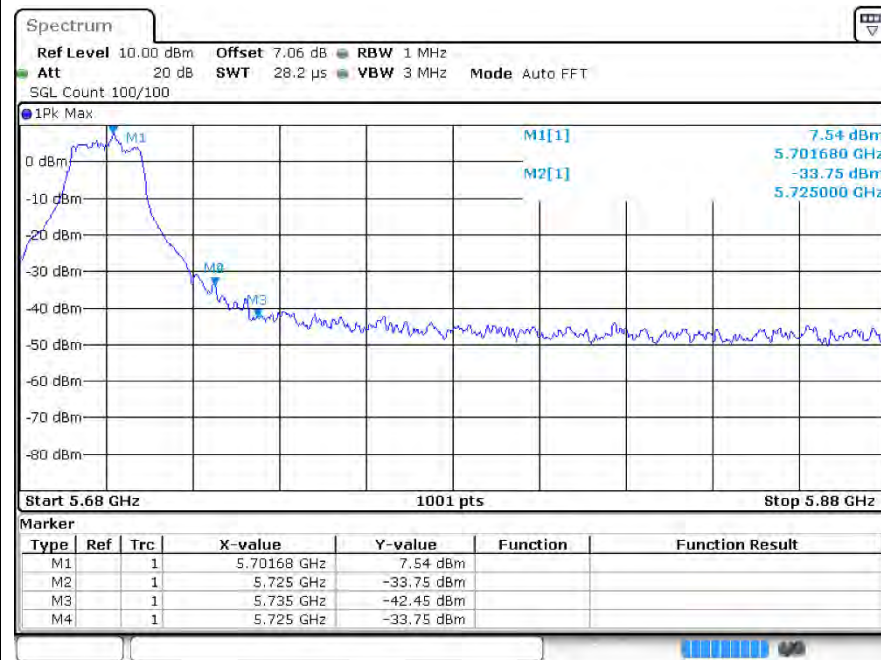


Restrict Band a 5700MHz Ant1 Average

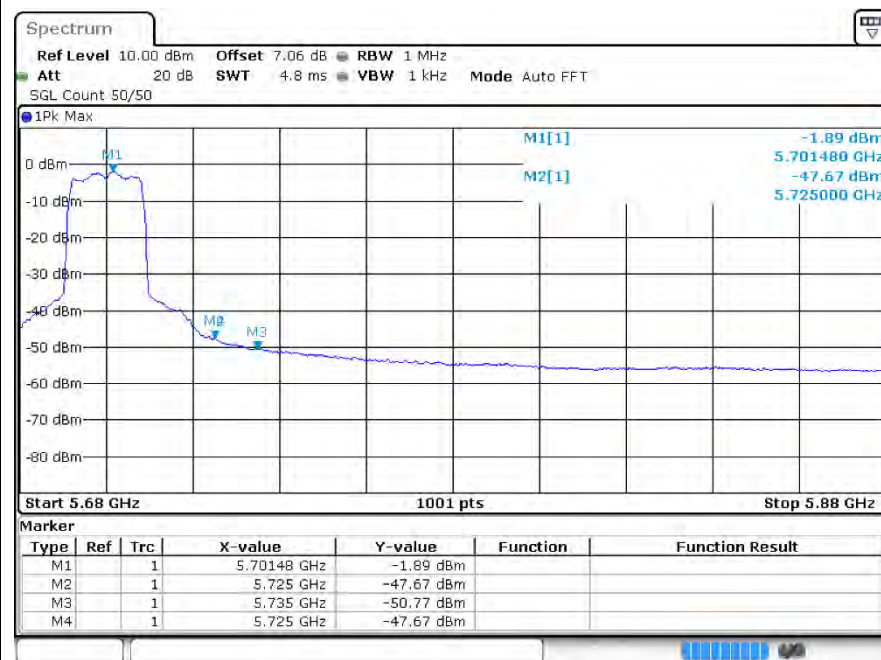


Restrict Bandn20 5180MHz Ant1 Peak

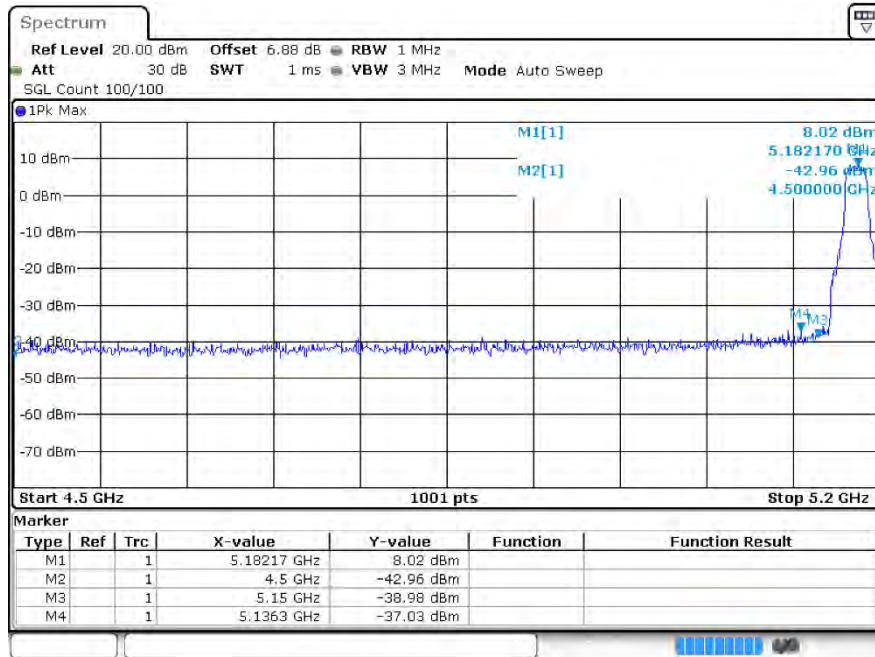


Restrict Band n20 5180MHz Ant1 Average

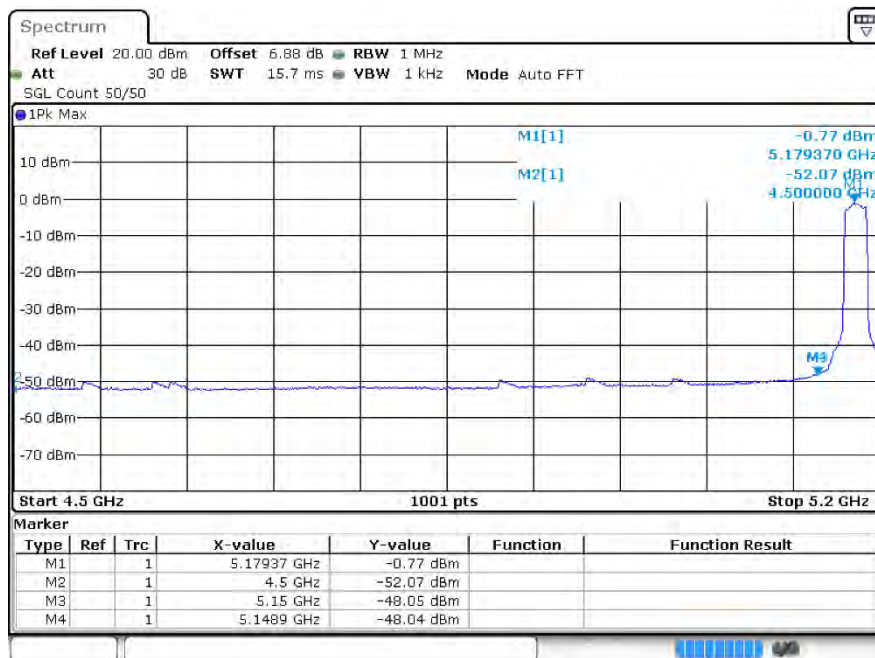


Restrict Bandn20 5240MHz Ant1 Peak

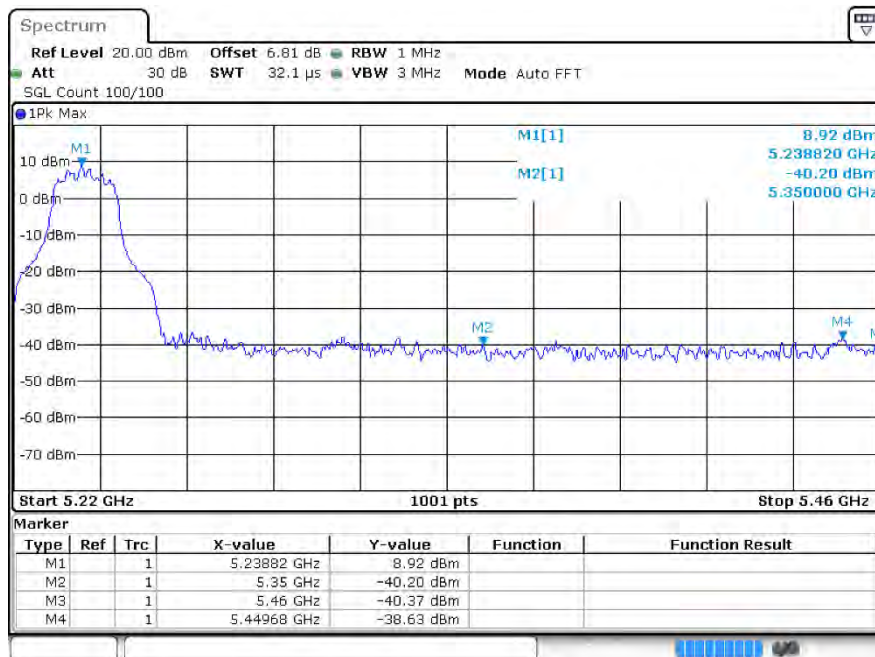


Restrict Band n20 5240MHz Ant1 Average

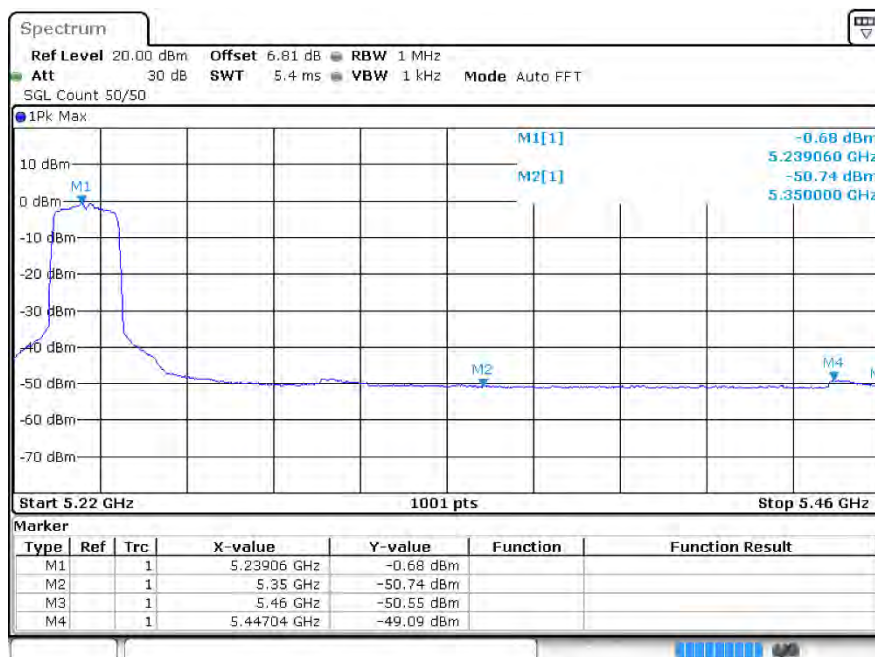


Restrict Bandn20 5260MHz Ant1 Peak

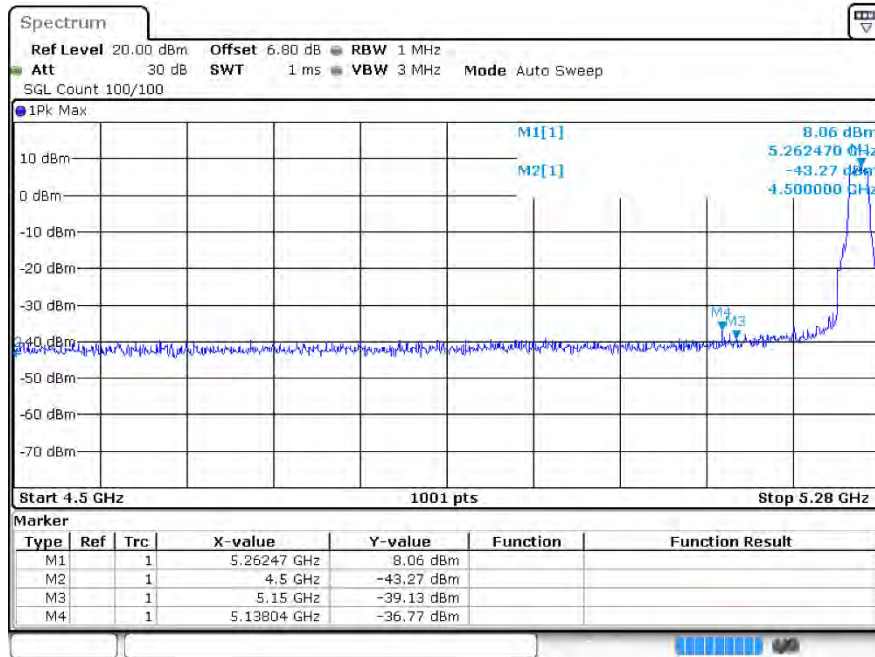


Restrict Band n20 5260MHz Ant1 Average

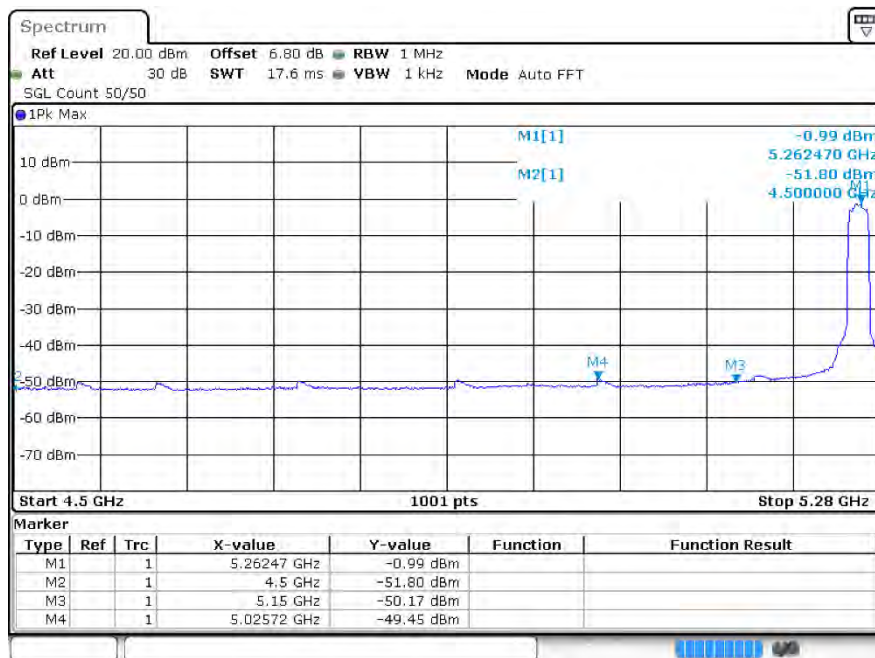


Restrict Bandn20 5320MHz Ant1 Peak

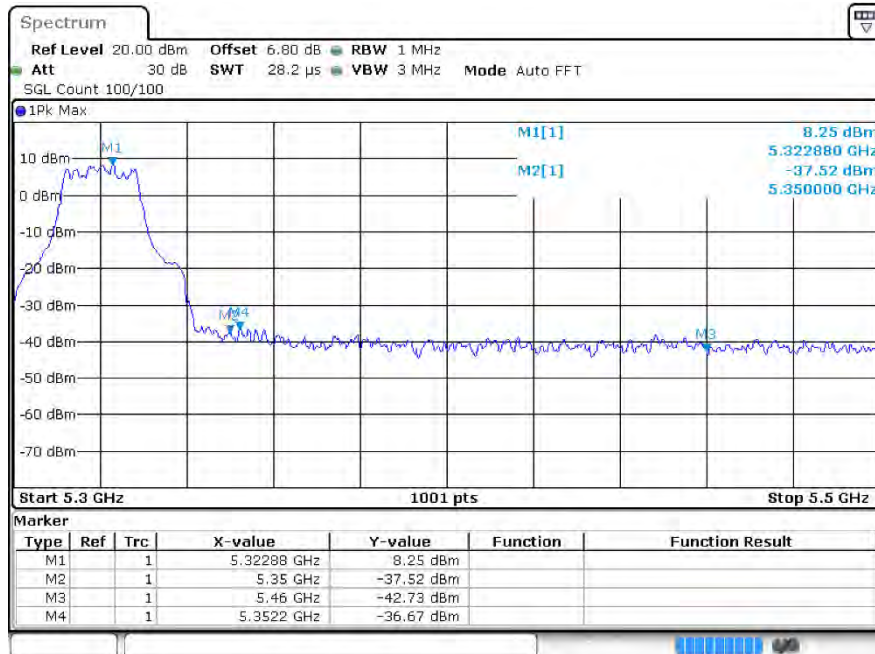


Restrict Band n20 5320MHz Ant1 Average

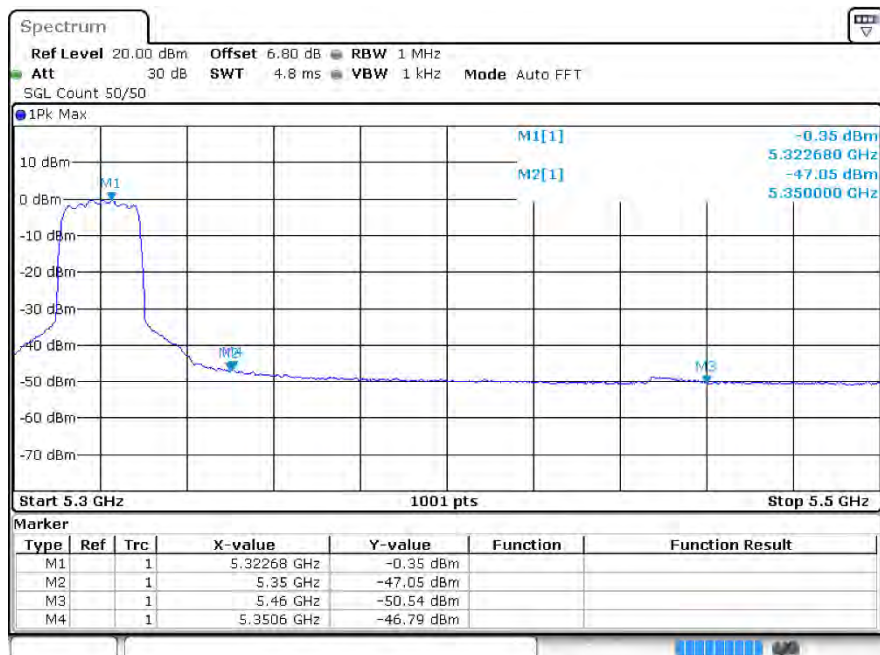

Restrict Bandn20 5500MHz Ant1 Peak

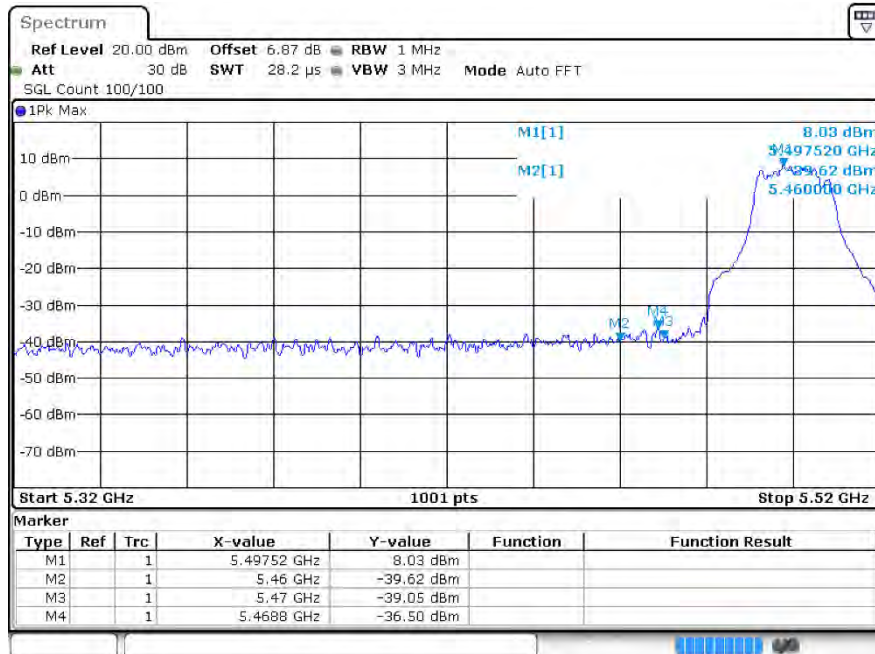


Restrict Band n20 5500MHz Ant1 Average

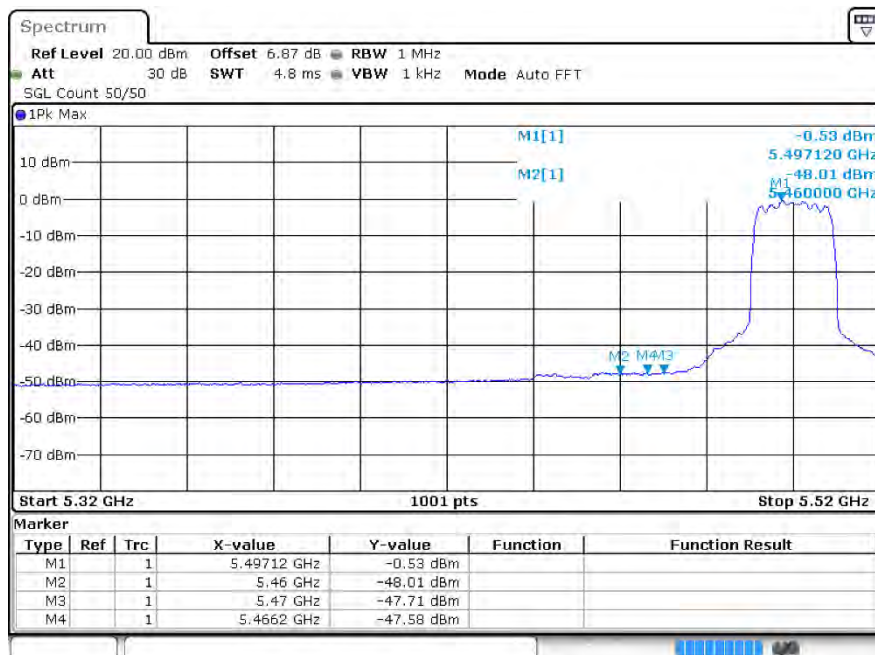





Restrict Bandn20 5700MHz Ant1 Peak

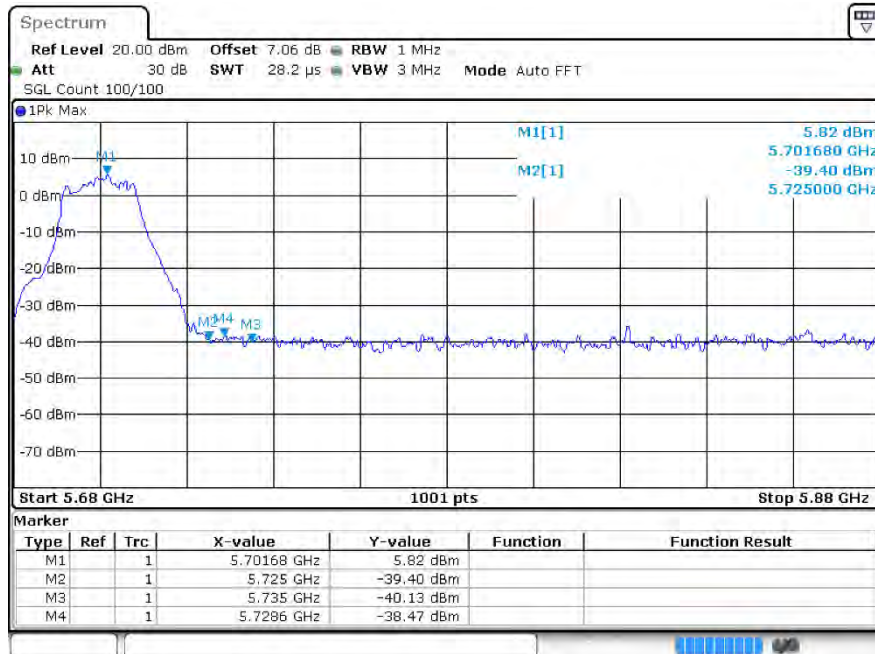


Restrict Band n20 5700MHz Ant1 Average

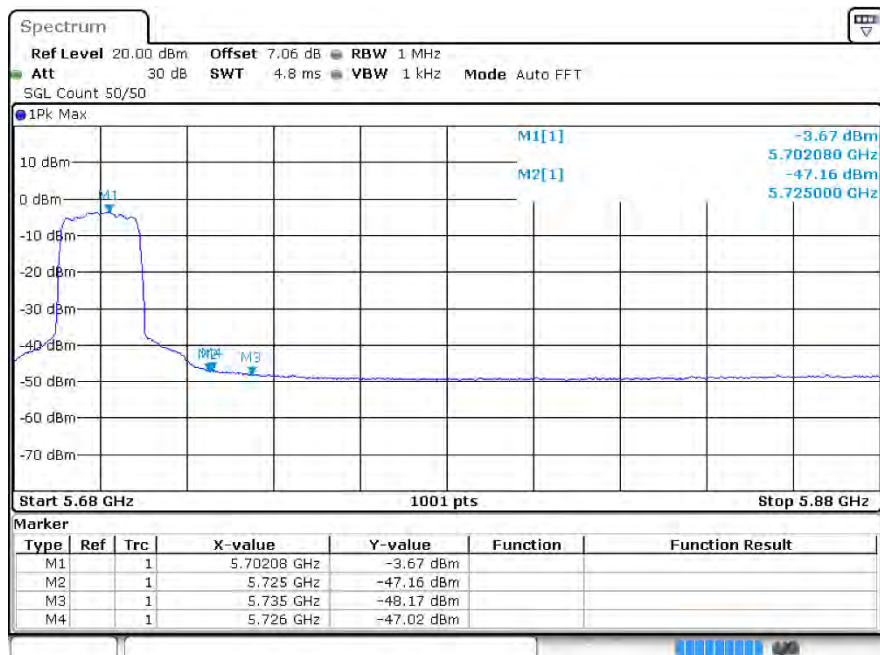


Restrict Bandn40 5190MHz Ant1 Peak

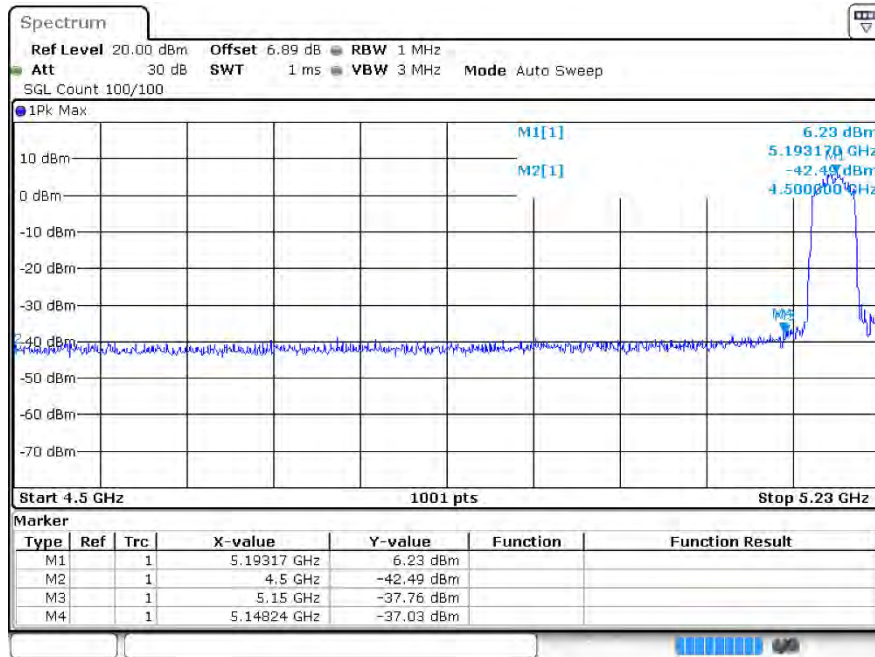


Restrict Band n40 5190MHz Ant1 Average

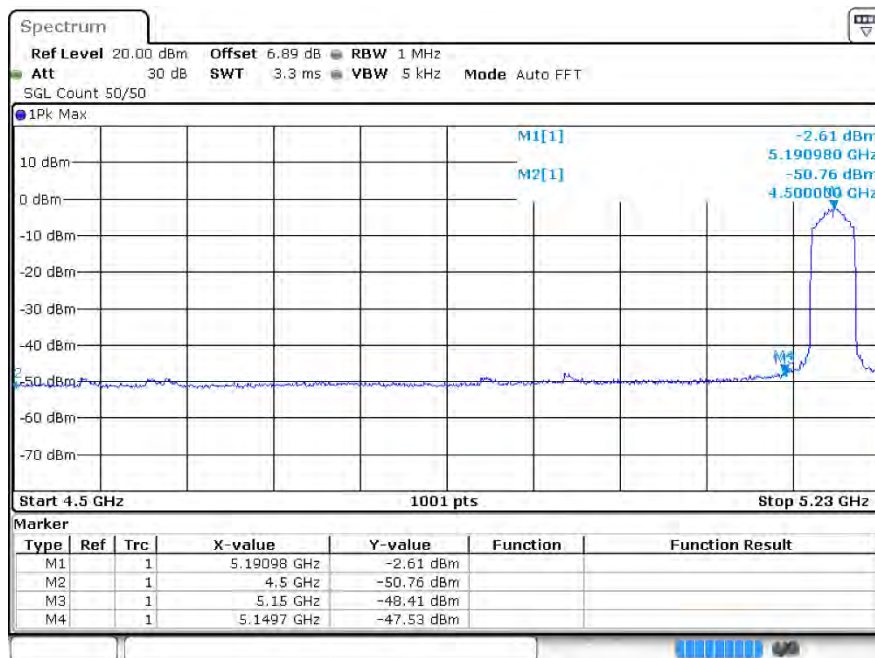


Restrict Bandn40 5230MHz Ant1 Peak

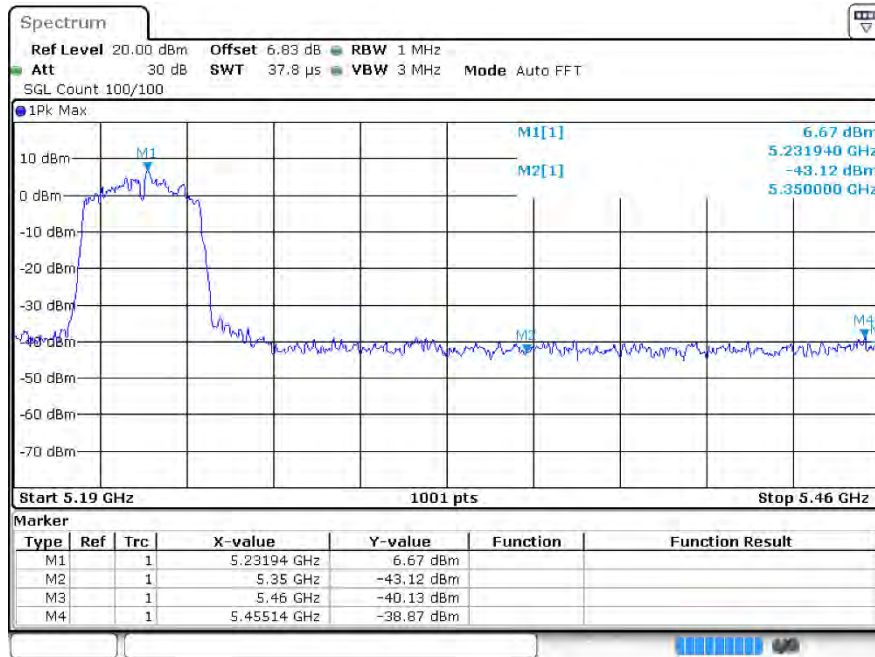


Restrict Band n40 5230MHz Ant1 Average

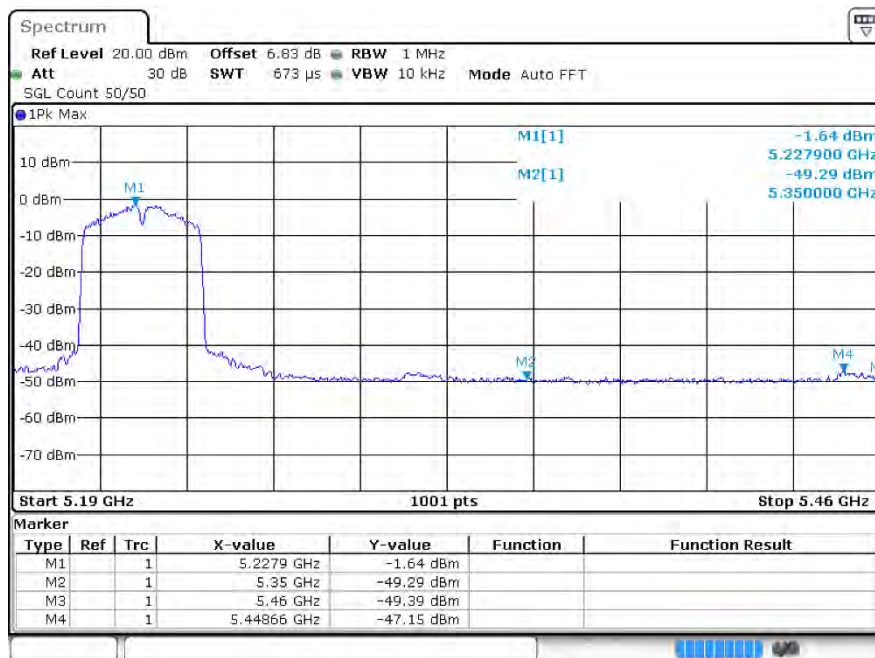


Restrict Band n40 5270MHz Ant1 Peak

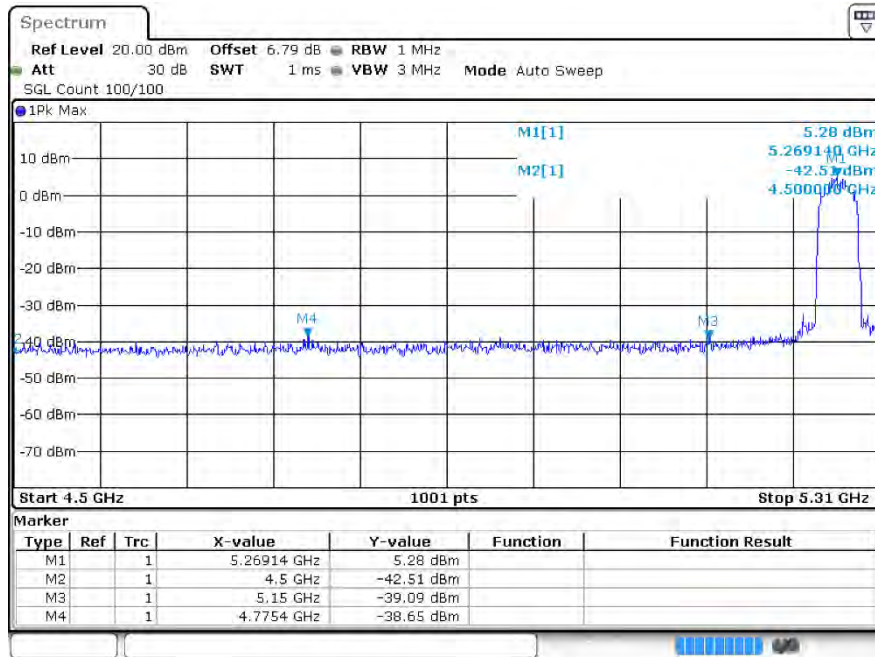

Restrict Band n40 5270MHz Ant1 Average

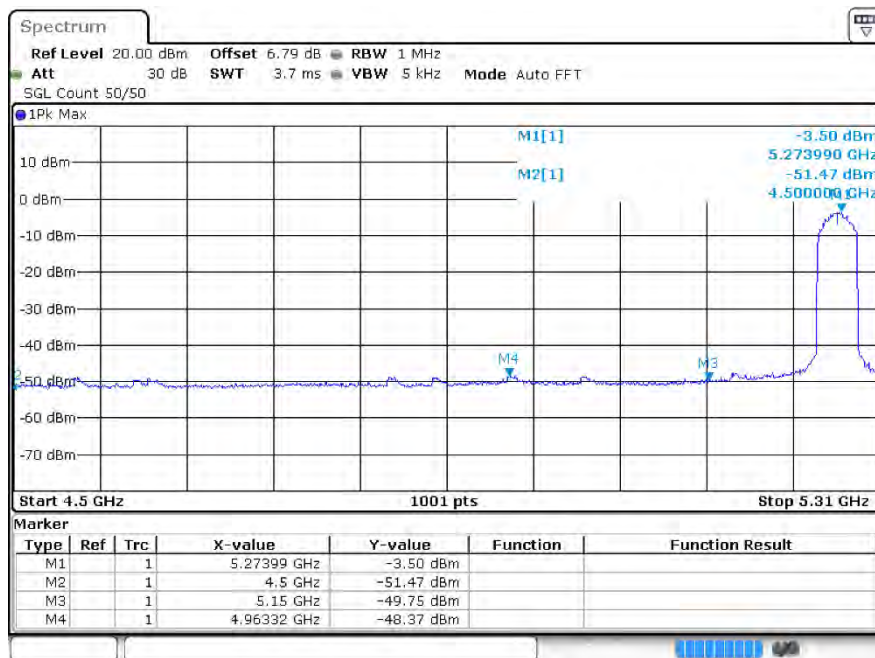


Restrict Bandn40 5310MHz Ant1 Peak

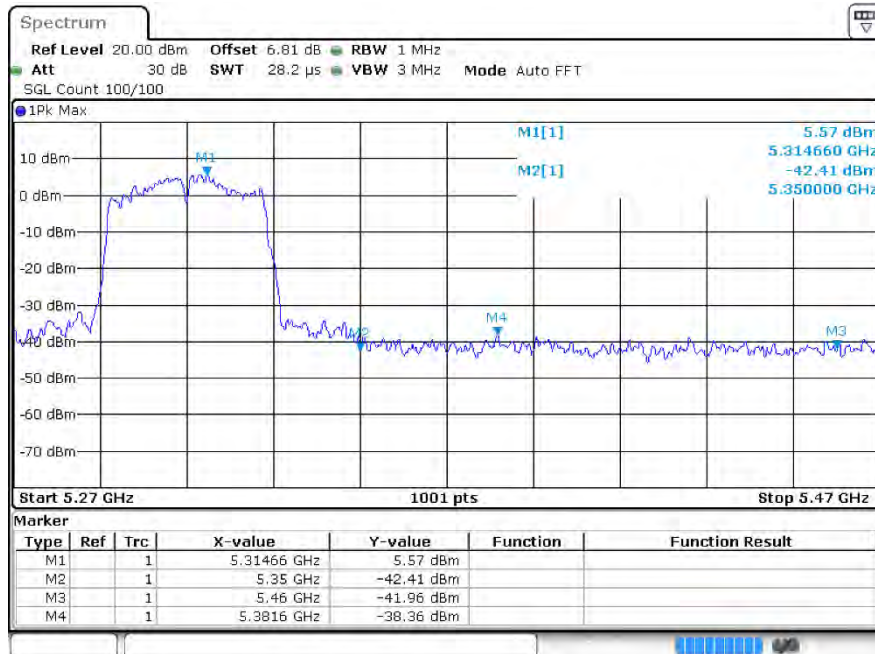


Restrict Band n40 5310MHz Ant1 Average




Restrict Bandn40 5510MHz Ant1 Peak

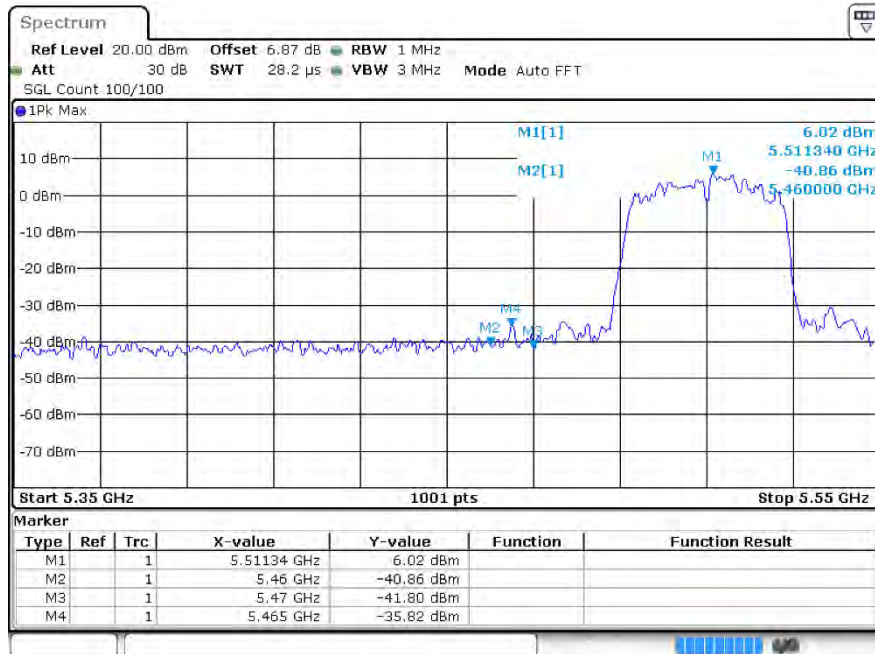

Restrict Band n40 5510MHz Ant1 Average

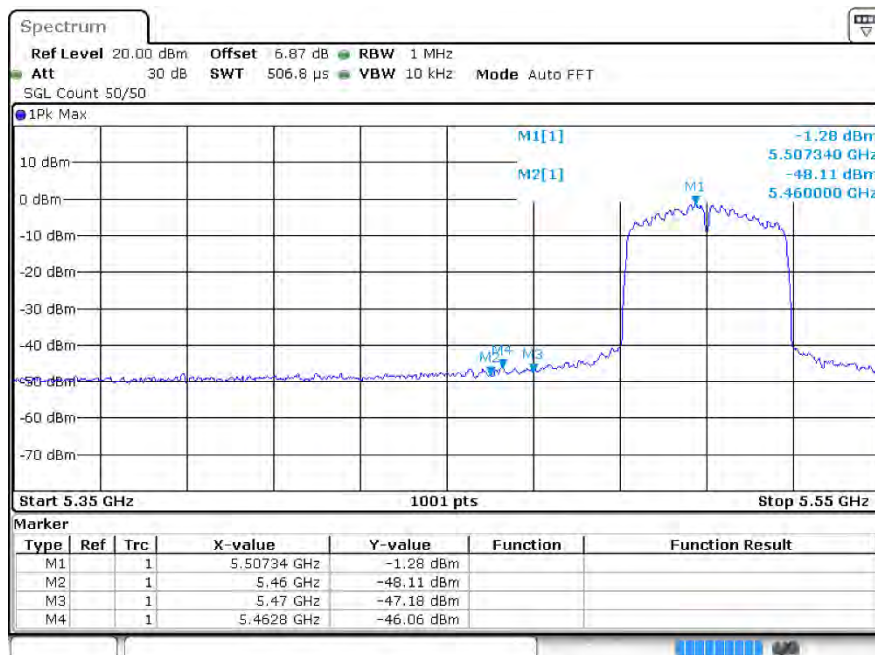


Restrict Bandn40 5670MHz Ant1 Peak

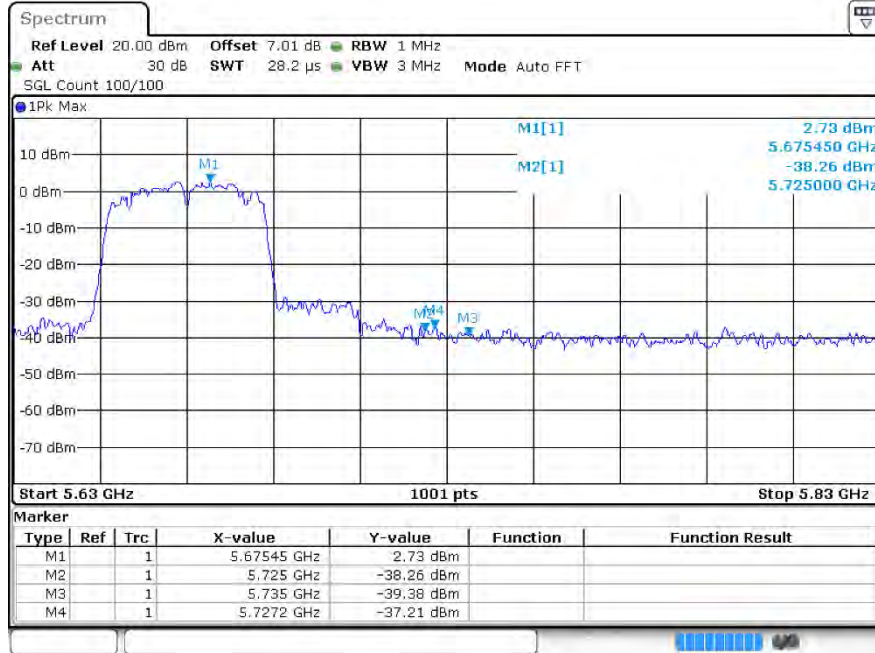


Restrict Band n40 5670MHz Ant1 Average



Restrict Bandac20 5180MHz Ant1 Peak

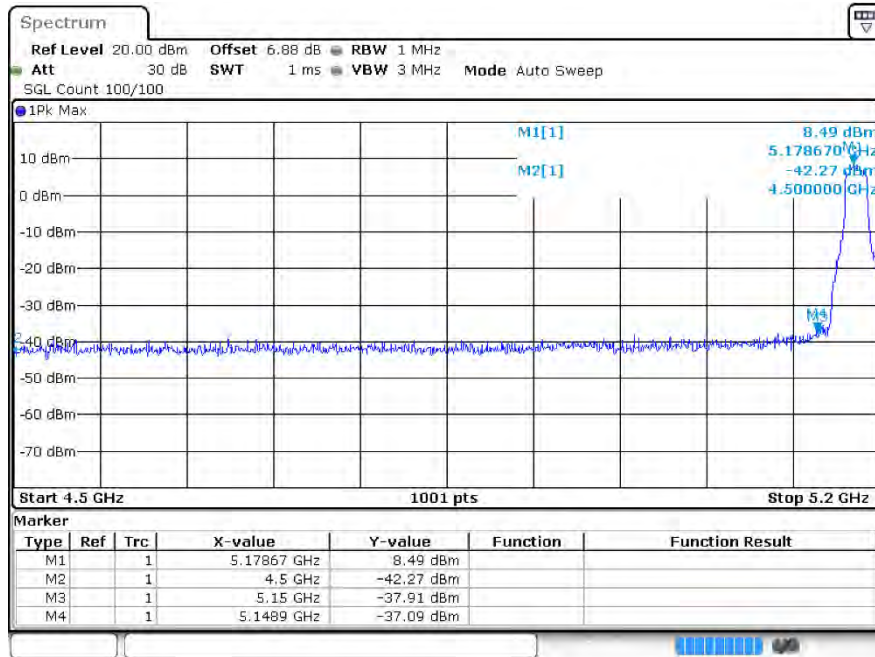


Restrict Band ac20 5180MHz Ant1 Average

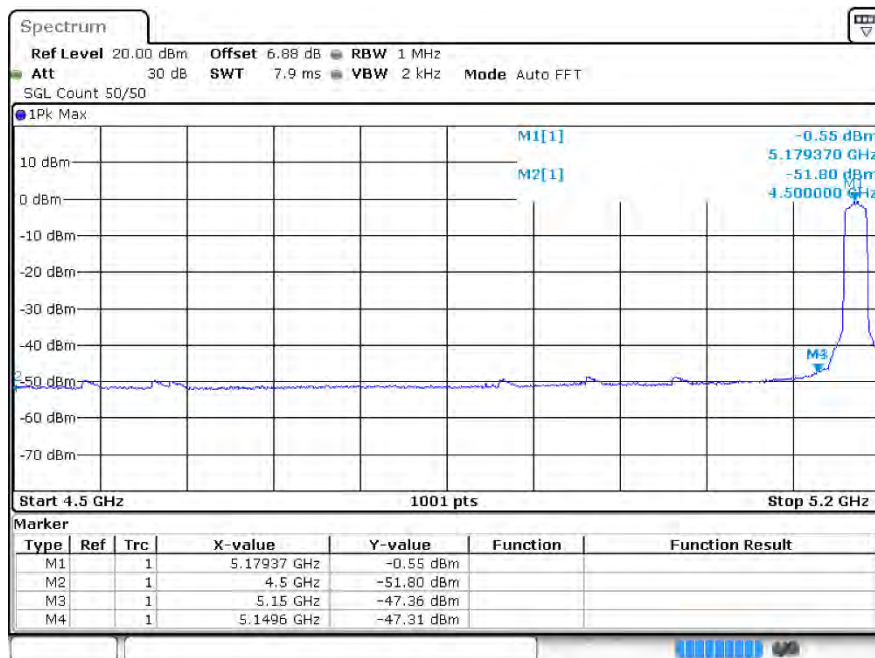





Restrict Bandac20 5240MHz Ant1 Peak

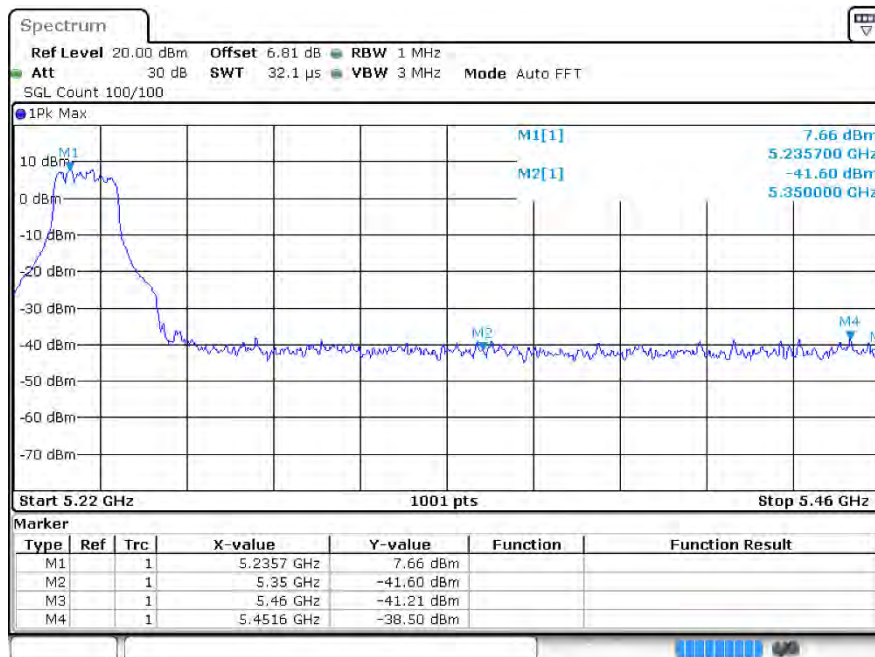


Restrict Band ac20 5240MHz Ant1 Average

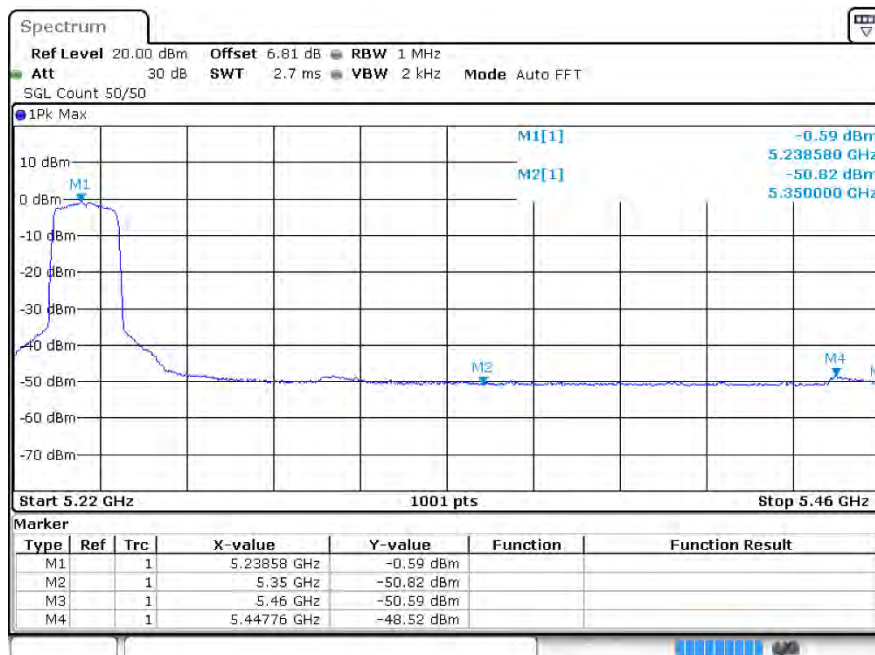


Restrict Bandac20 5260MHz Ant1 Peak

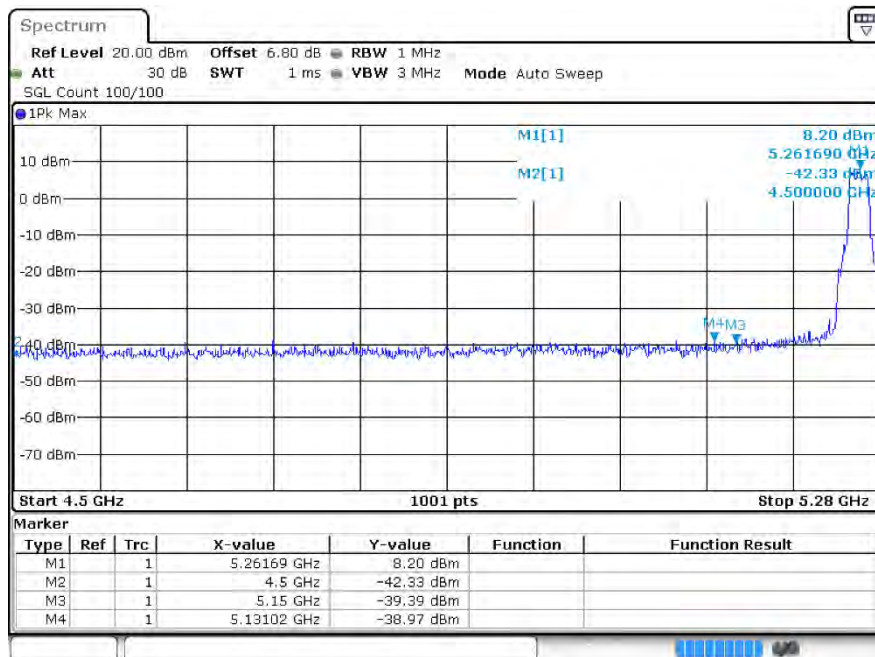


Restrict Band ac20 5260MHz Ant1 Average

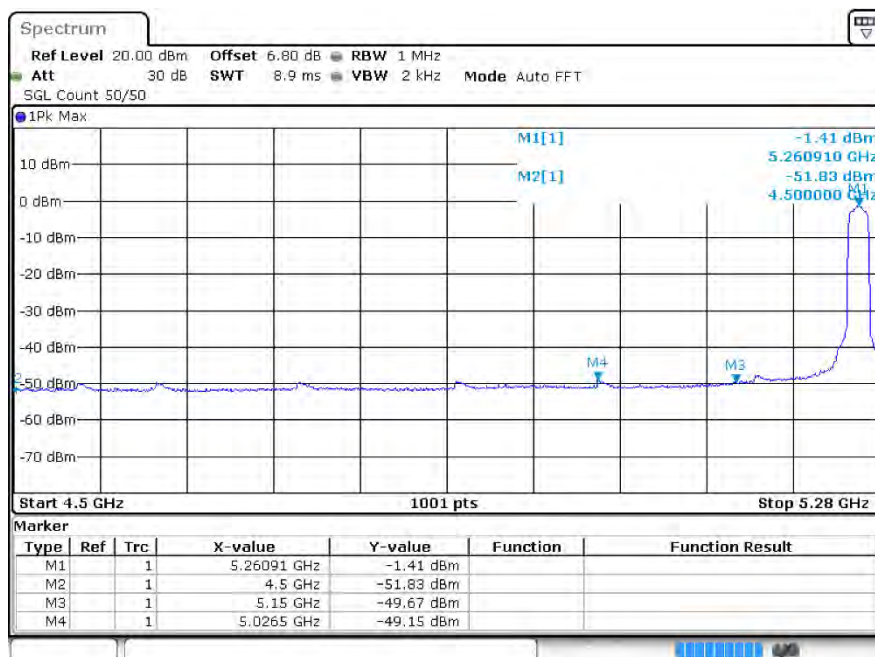


Restrict Bandac20 5320MHz Ant1 Peak

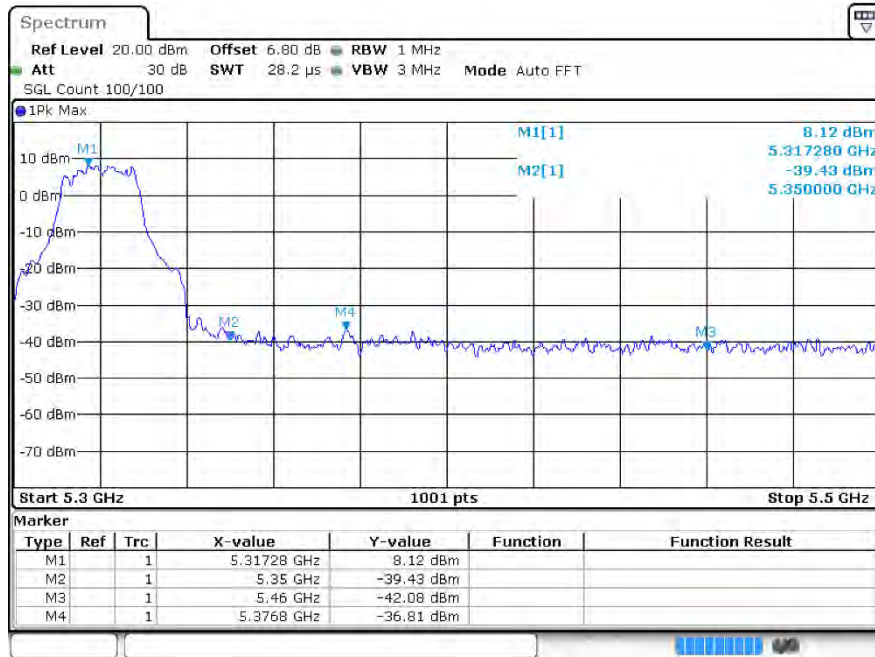

Restrict Band ac20 5320MHz Ant1 Average

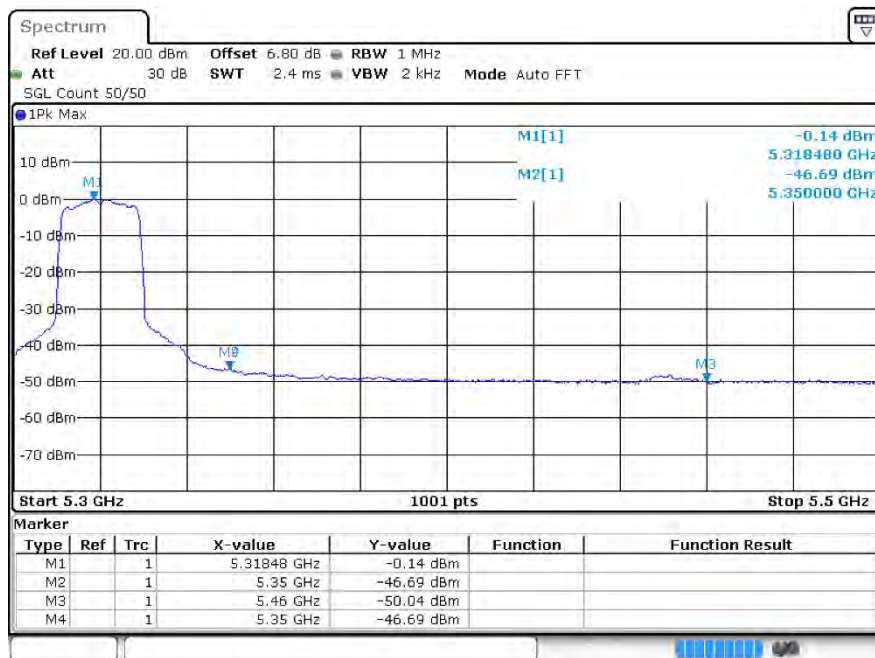


Restrict Bandac20 5500MHz Ant1 Peak

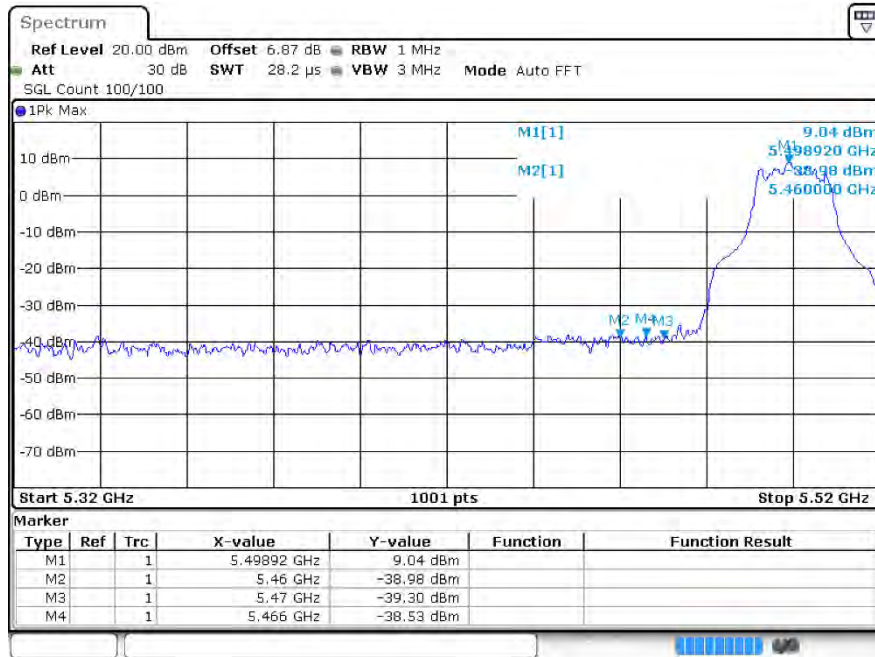


Restrict Band ac20 5500MHz Ant1 Average




Restrict Bandac20 5700MHz Ant1 Peak

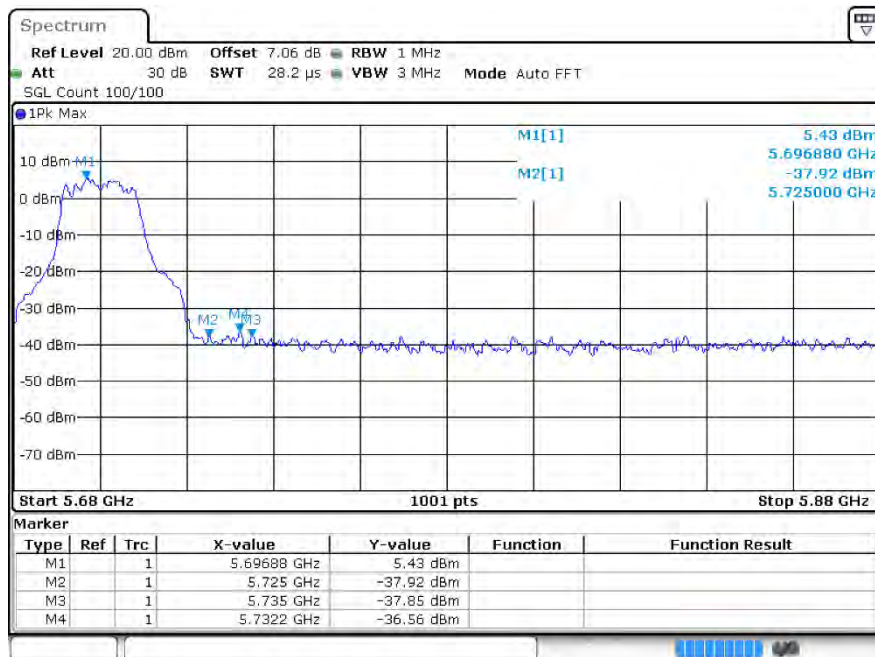


Restrict Band ac20 5700MHz Ant1 Average

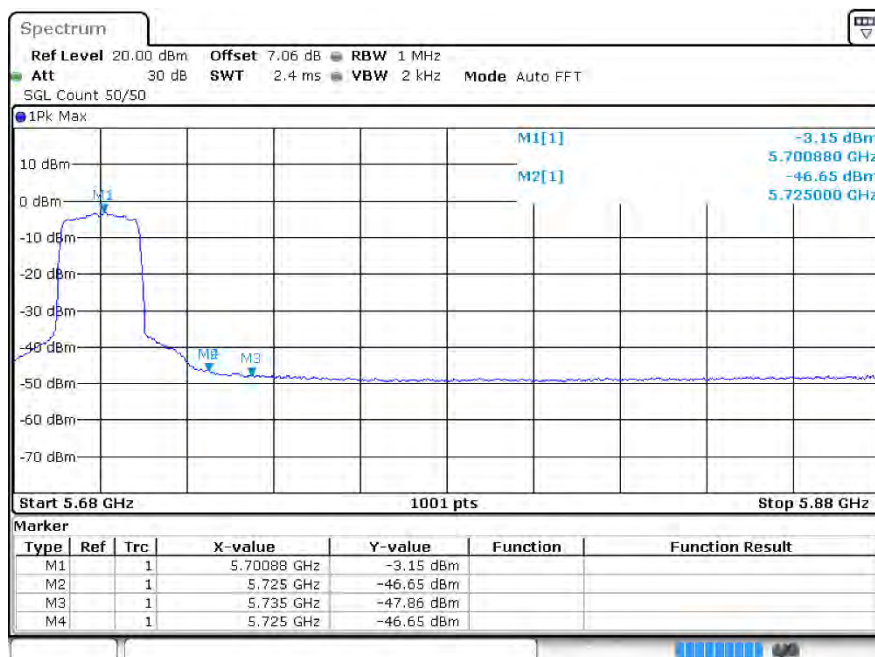


Restrict Bandac40 5190MHz Ant1 Peak

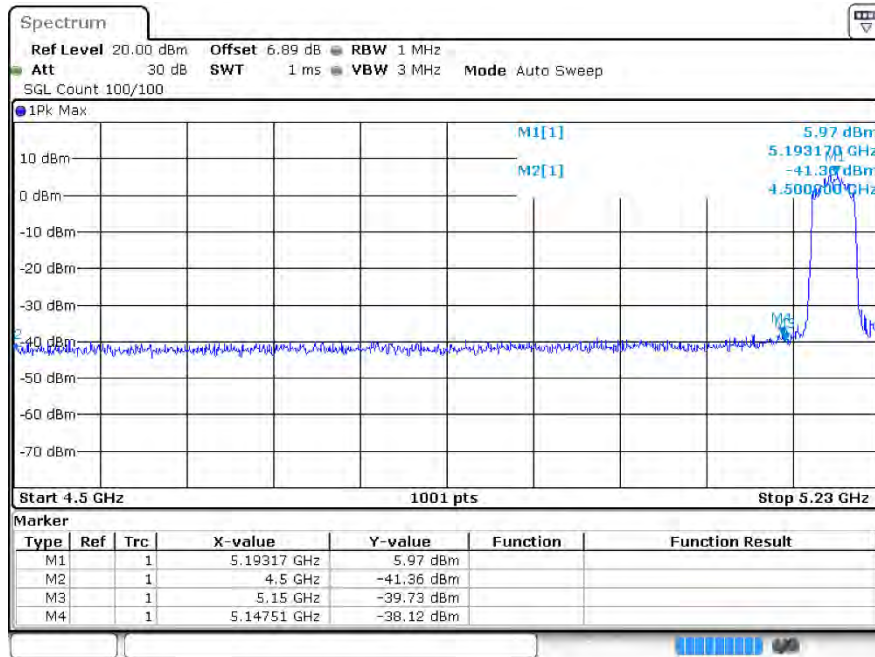


Restrict Band ac40 5190MHz Ant1 Average

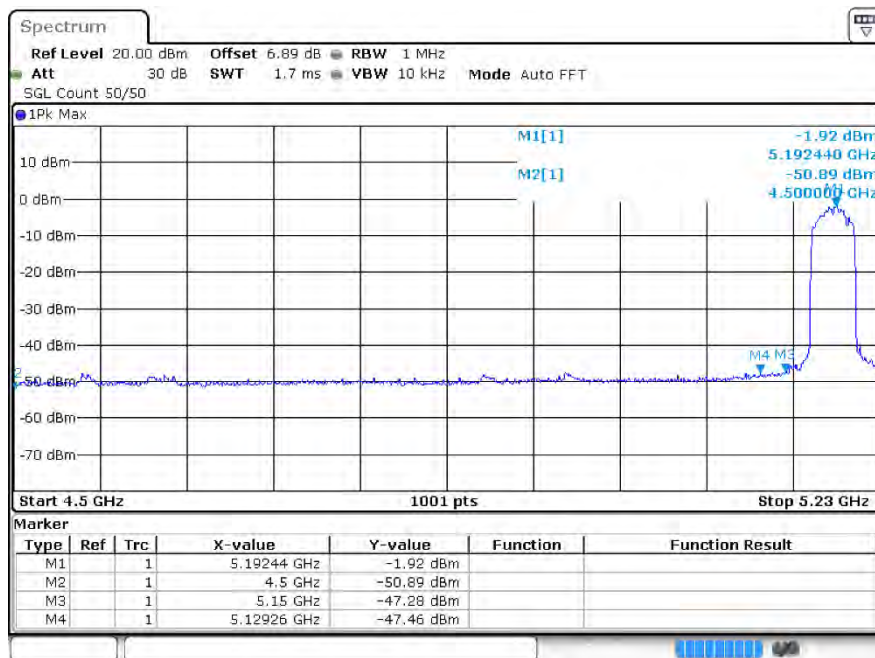

Restrict Bandac40 5230MHz Ant1 Peak

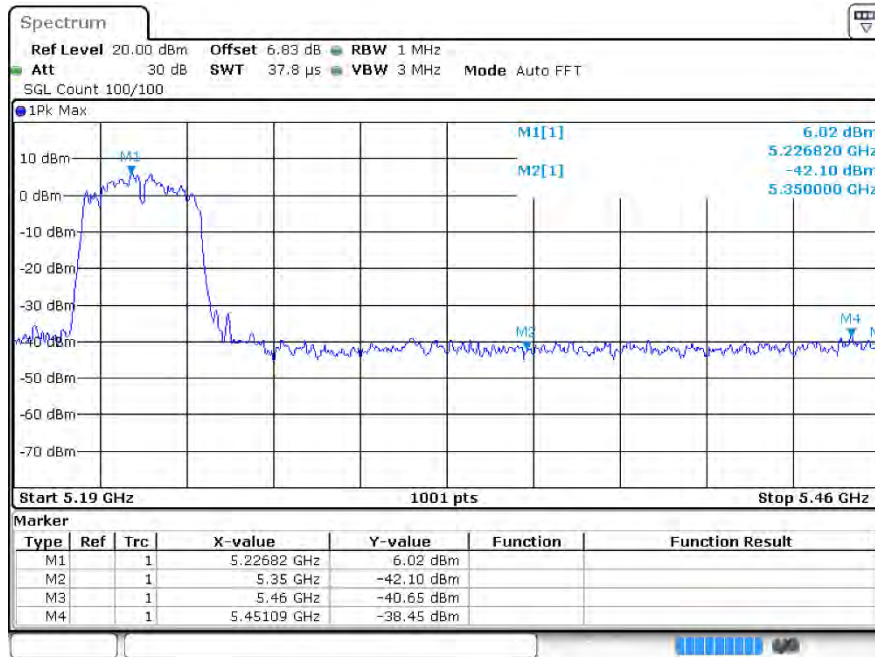


Restrict Band ac40 5230MHz Ant1 Average

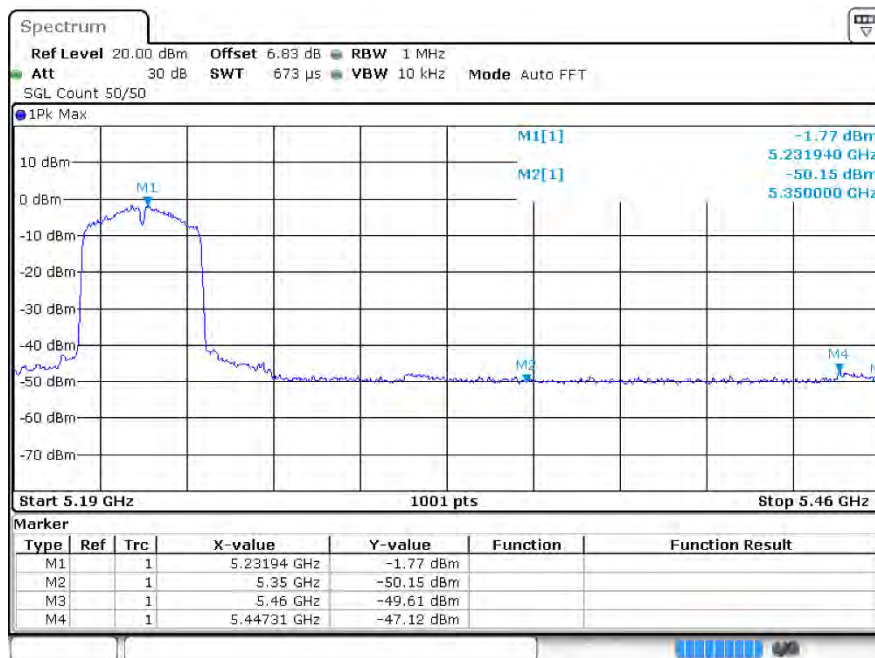





Restrict Bandac40 5270MHz Ant1 Peak

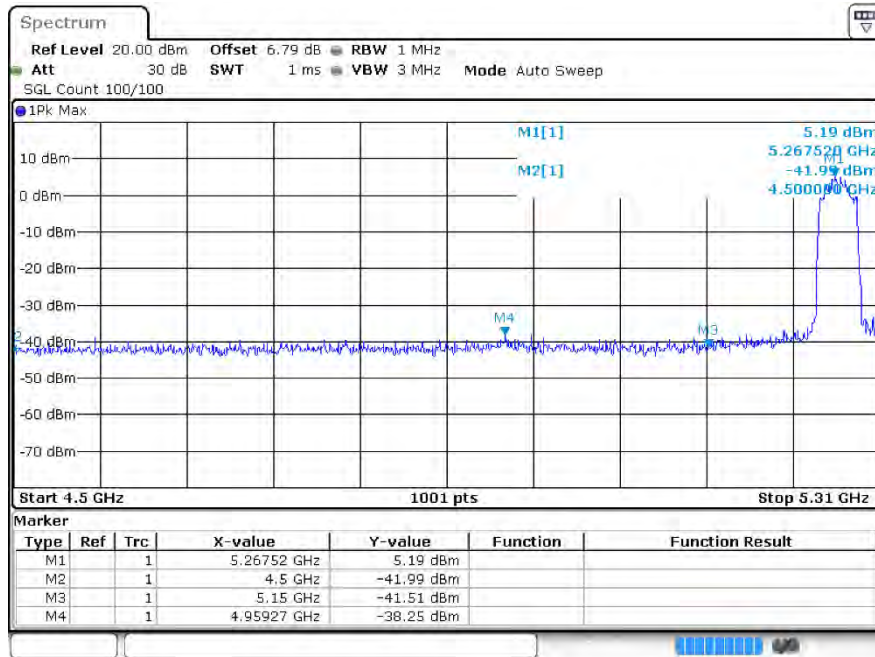

Restrict Band ac40 5270MHz Ant1 Average

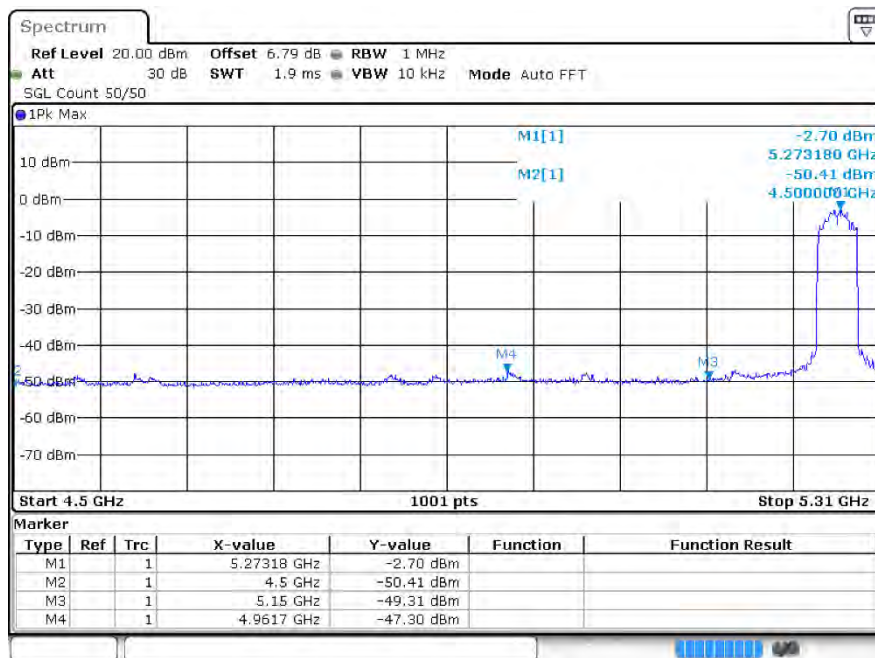


Restrict Bandac40 5310MHz Ant1 Peak

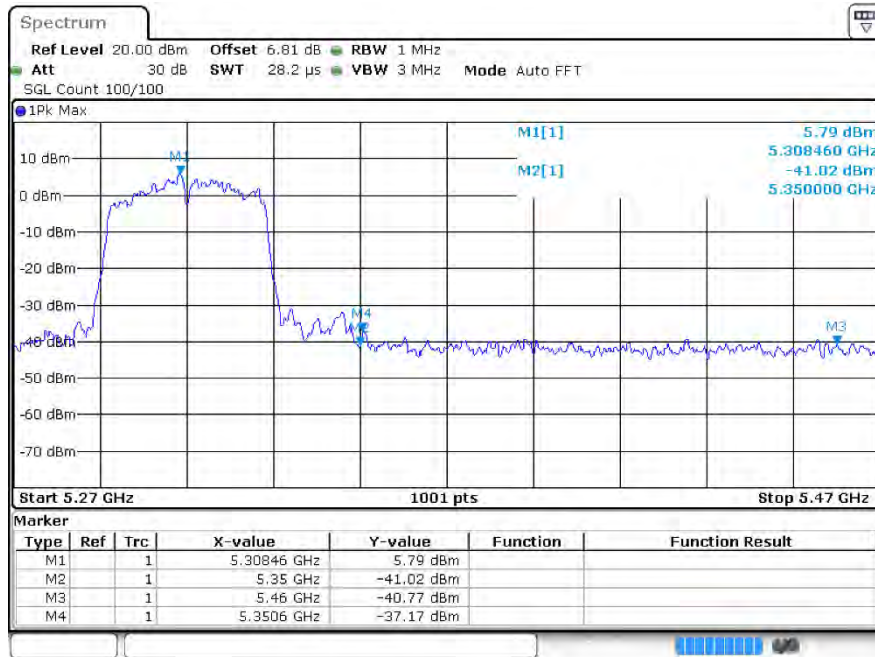

Restrict Band ac40 5310MHz Ant1 Average




Restrict Bandac40 5510MHz Ant1 Peak

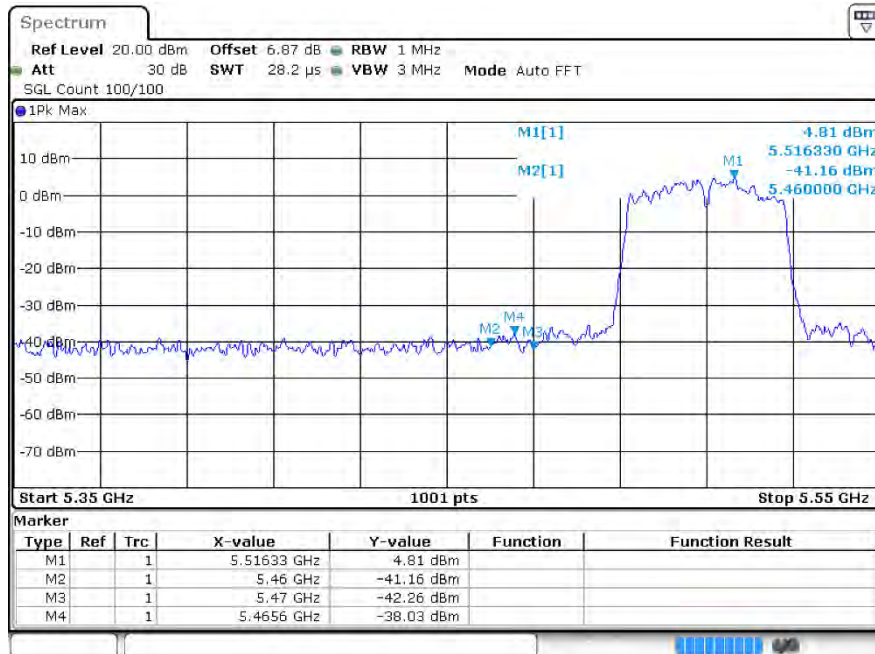


Restrict Band ac40 5510MHz Ant1 Average




Restrict Bandac40 5670MHz Ant1 Peak

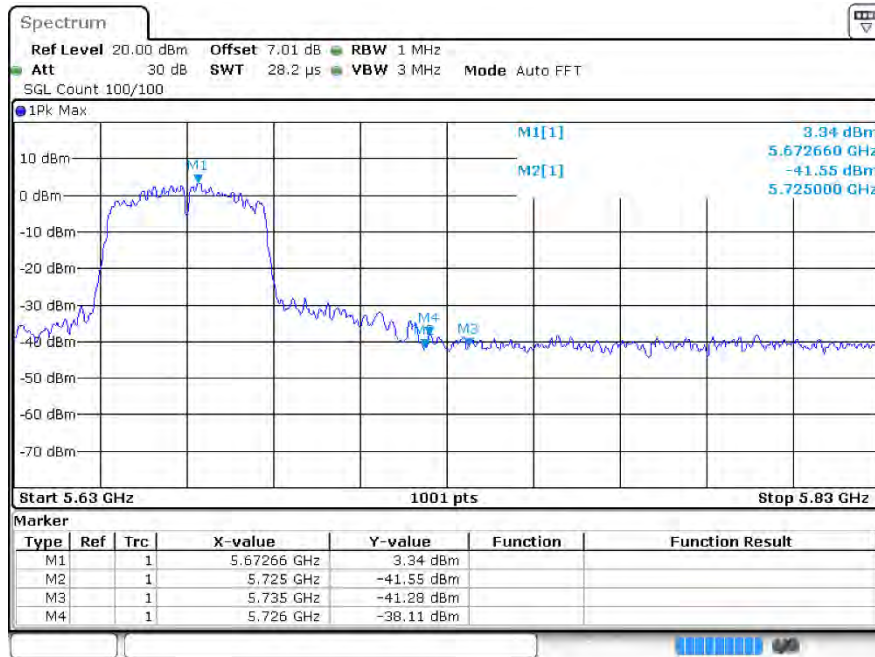


Restrict Band ac40 5670MHz Ant1 Average

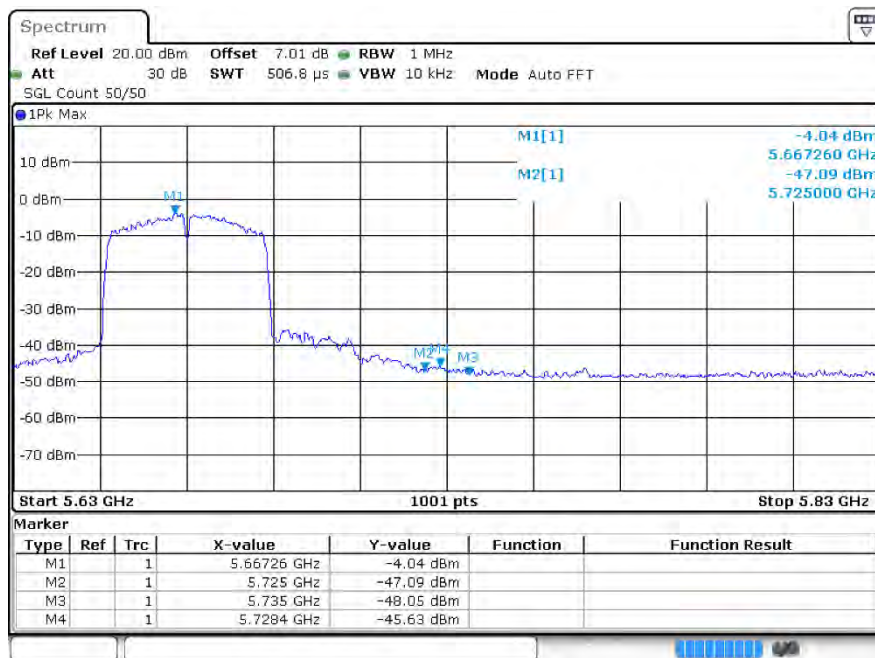


Restrict Bandac80 5210MHz Ant1 Peak

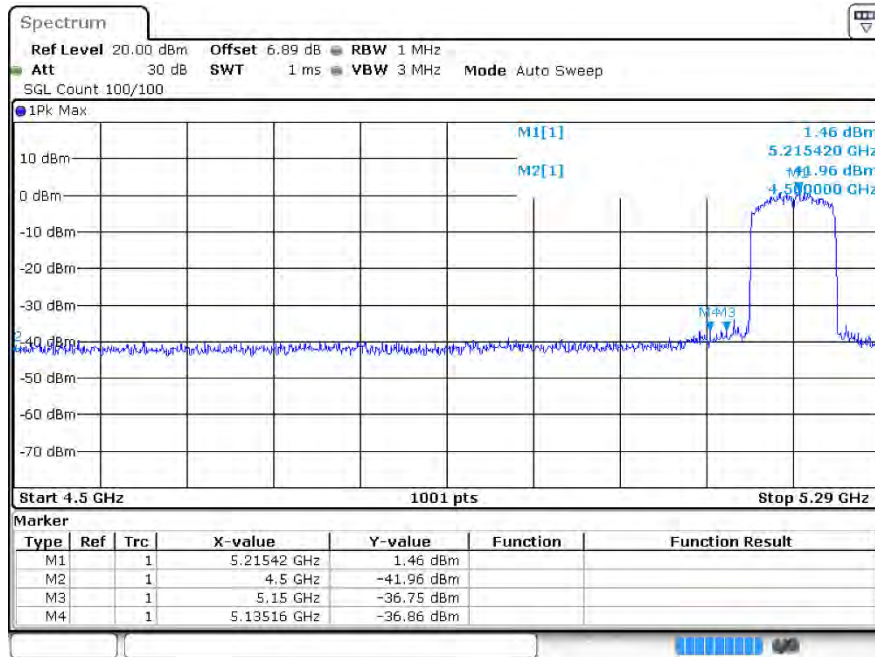

Restrict Band ac80 5210MHz Ant1 Average

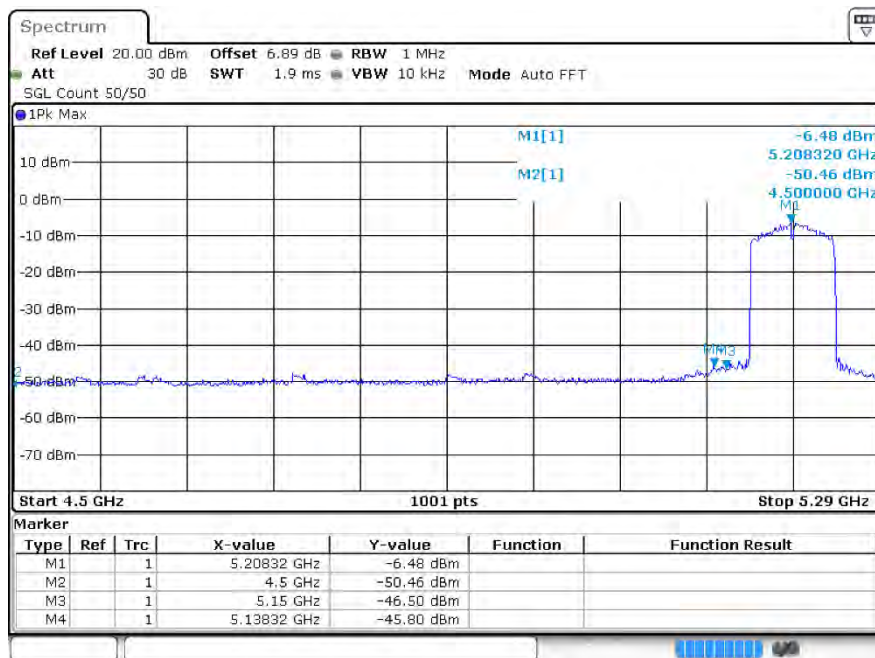


Restrict Bandac80 5290MHz Ant1 Peak

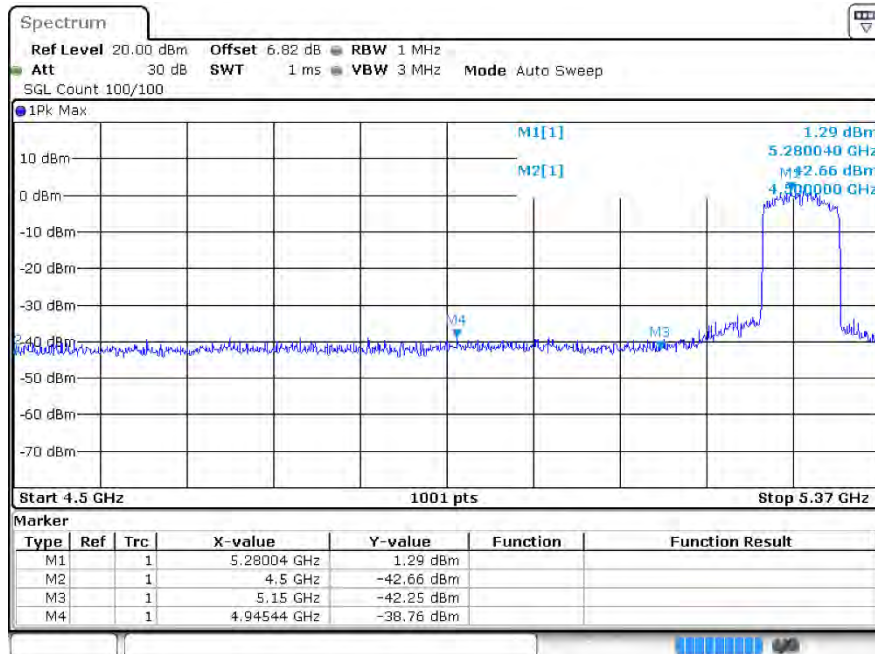


Restrict Band ac80 5290MHz Ant1 Average




Restrict Bandac80 5530MHz Ant1 Peak

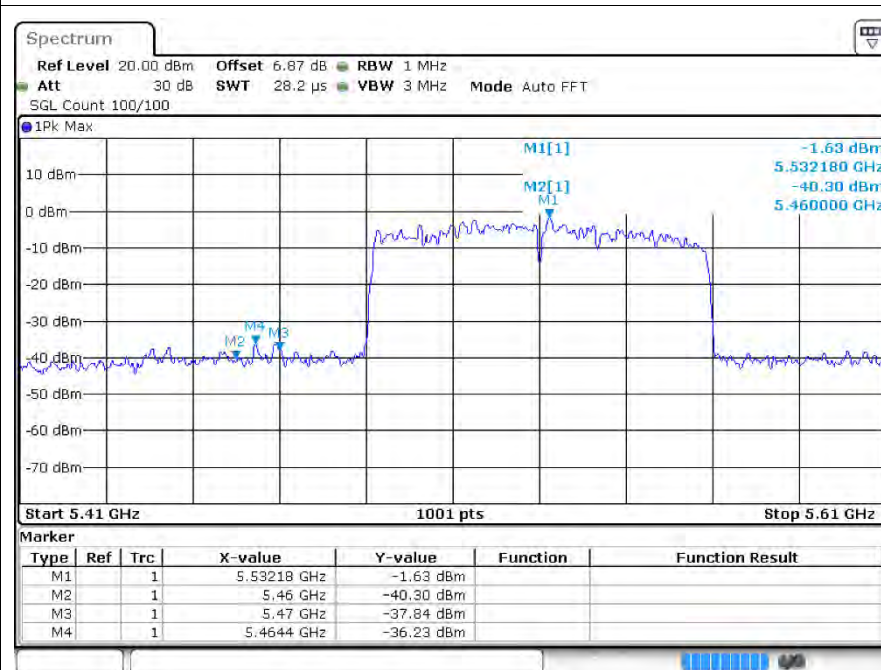


Restrict Band ac80 5530MHz Ant1 Average

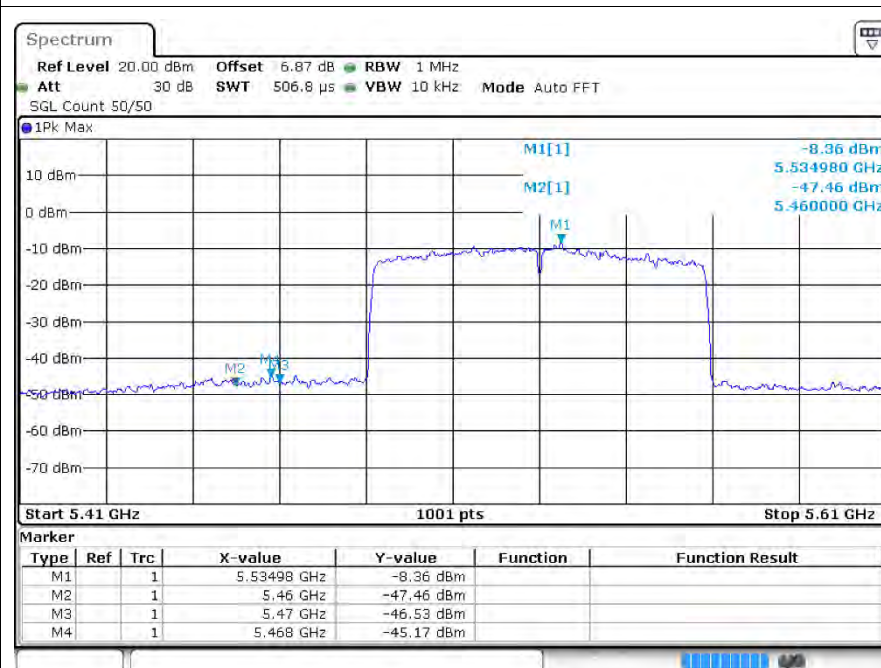


Restrict Bandac80 5610MHz Ant1 Peak

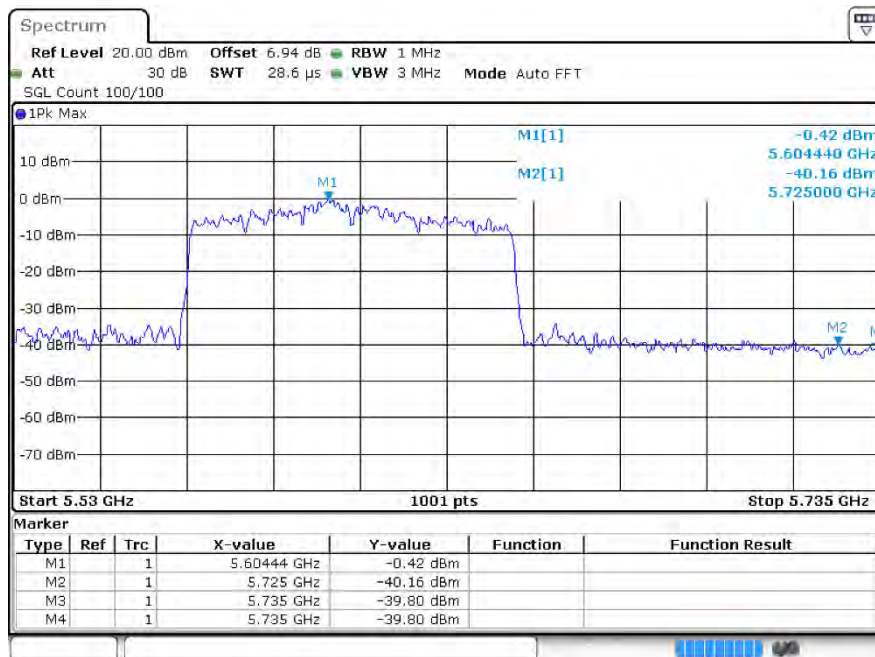


Restrict Band ac80 5610MHz Ant1 Average

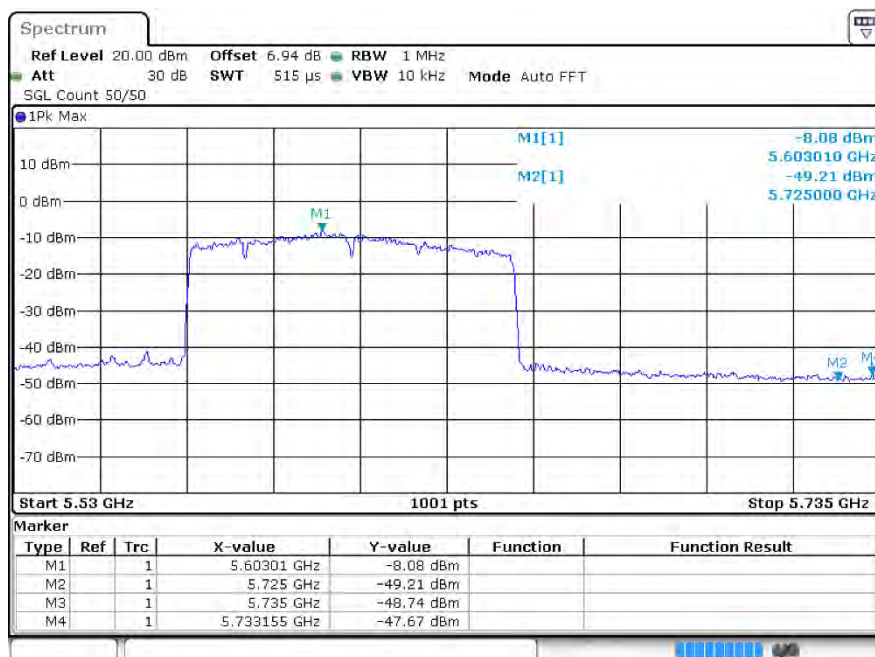


Restrict Bandax20 5180MHz Ant1 Peak

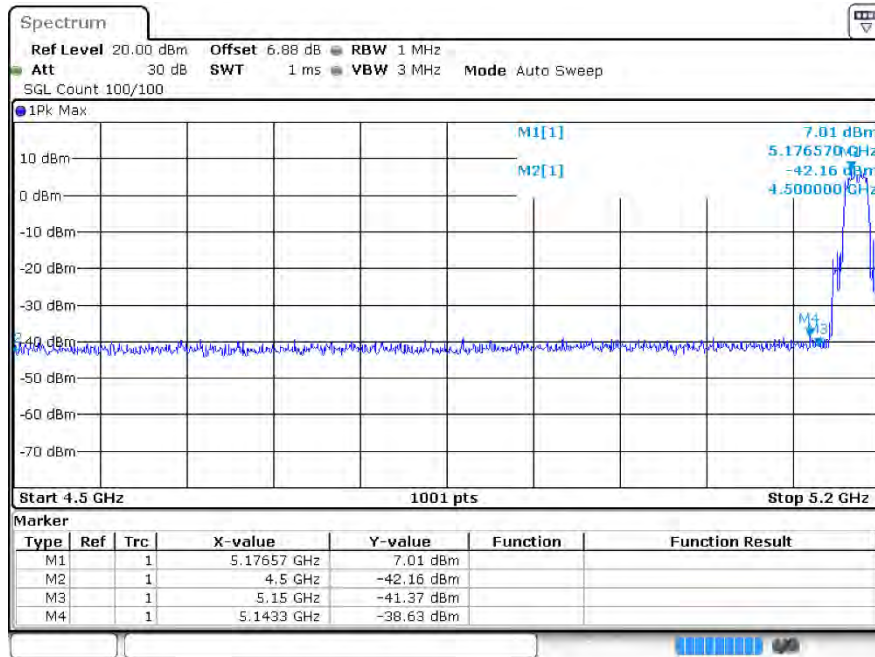


Restrict Band ax20 5180MHz Ant1 Average

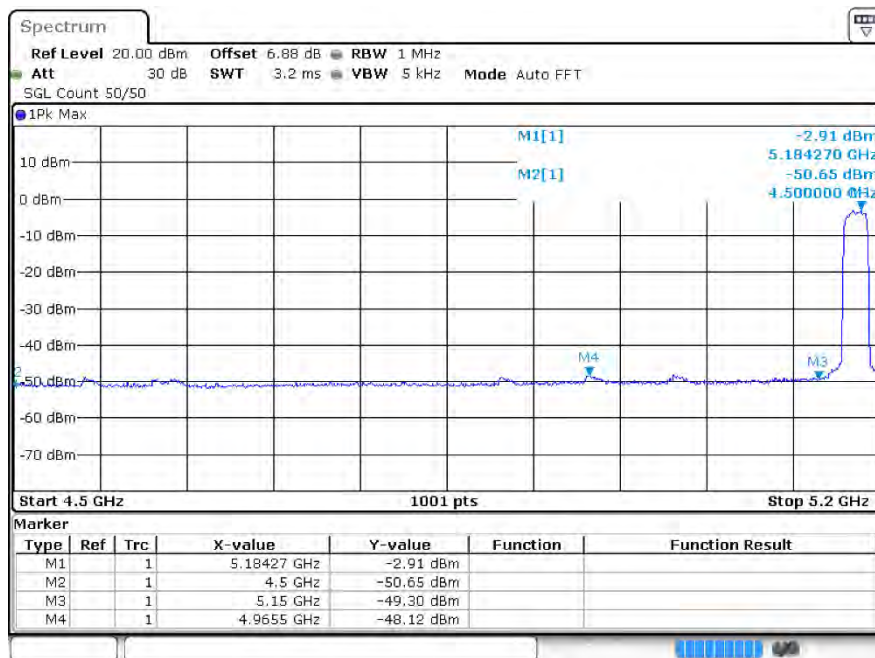

Restrict Bandax20 5240MHz Ant1 Peak

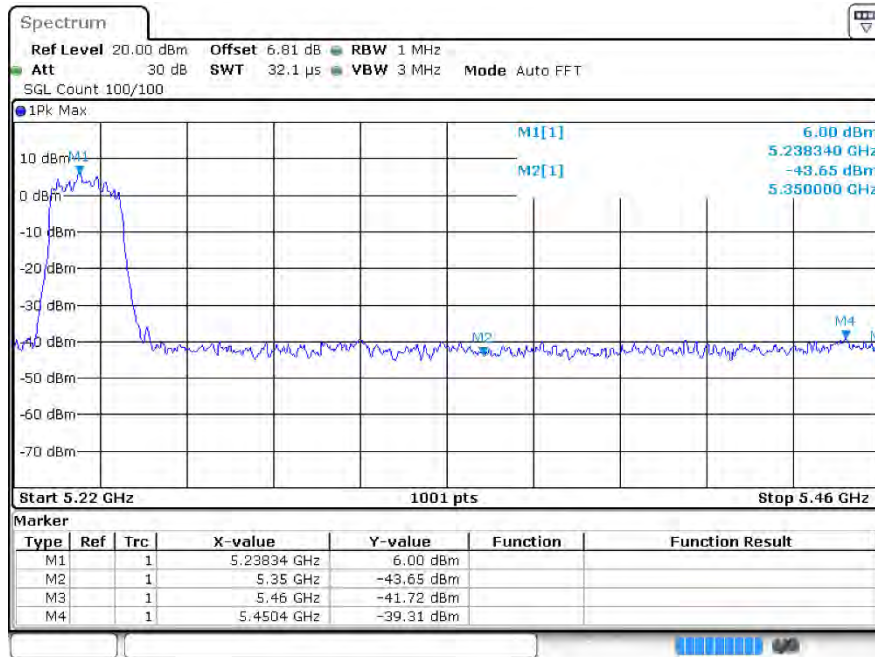


Restrict Band ax20 5240MHz Ant1 Average

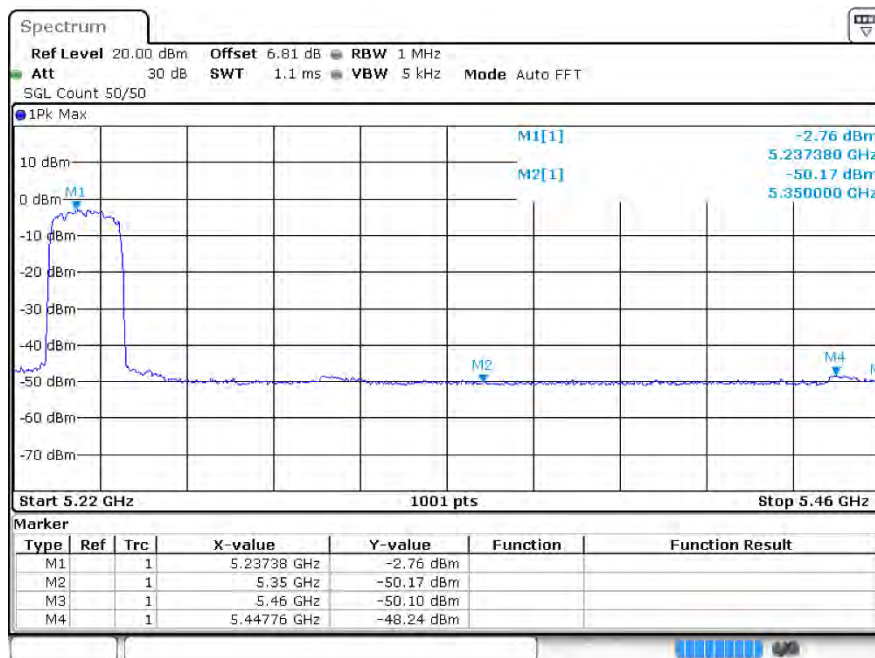





Restrict Bandax20 5260MHz Ant1 Peak

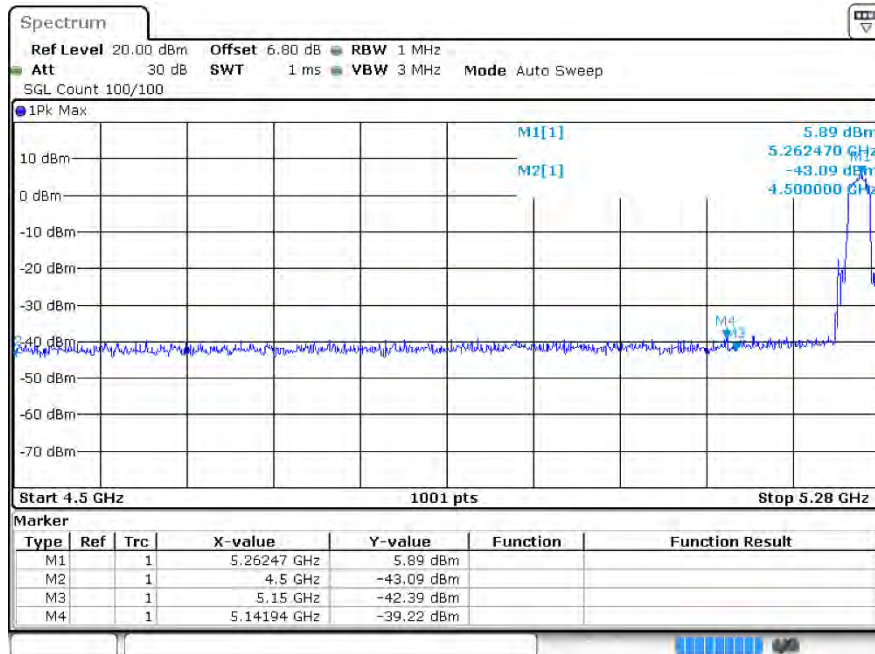


Restrict Band ax20 5260MHz Ant1 Average

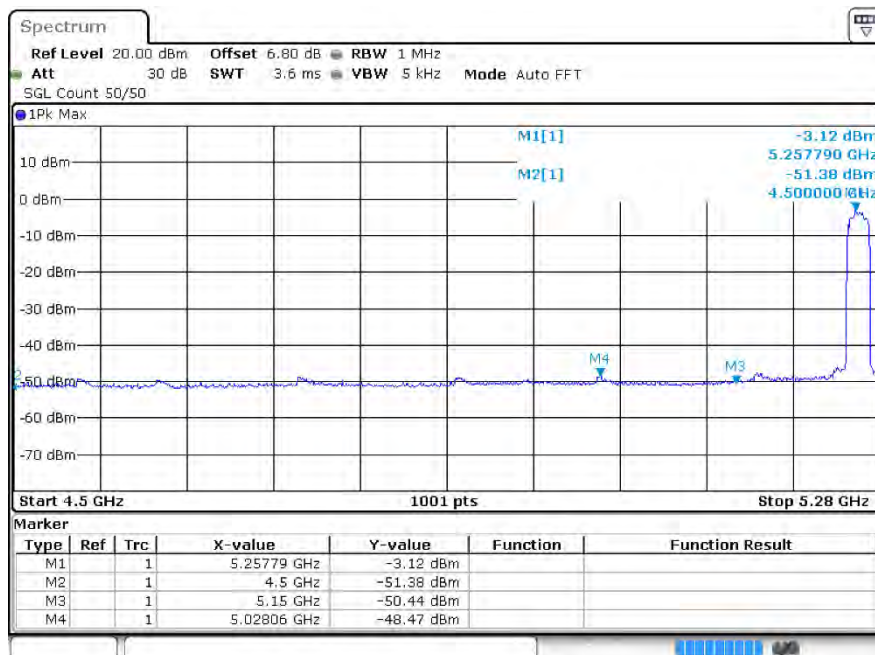


Restrict Bandx20 5320MHz Ant1 Peak

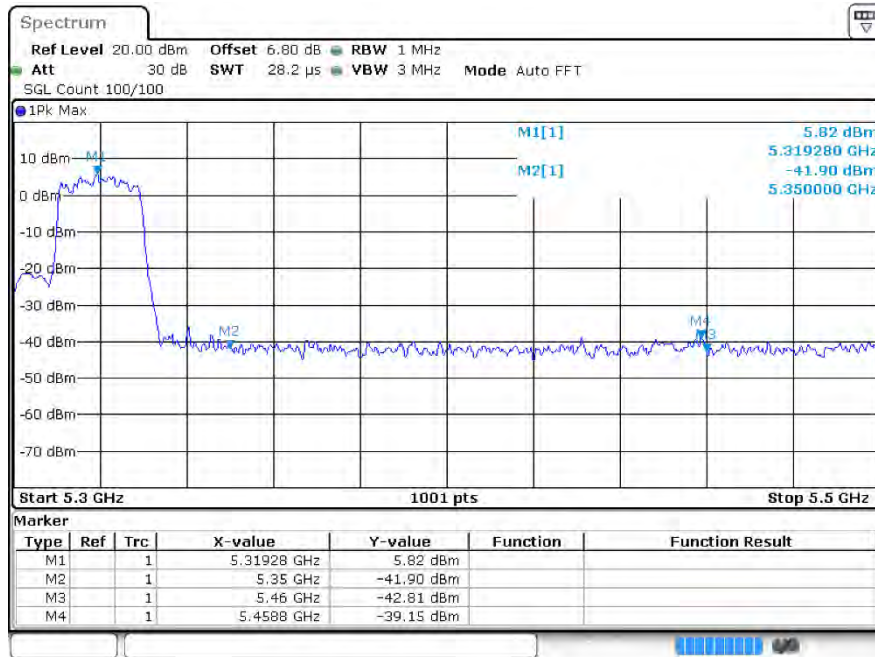


Restrict Band ax20 5320MHz Ant1 Average

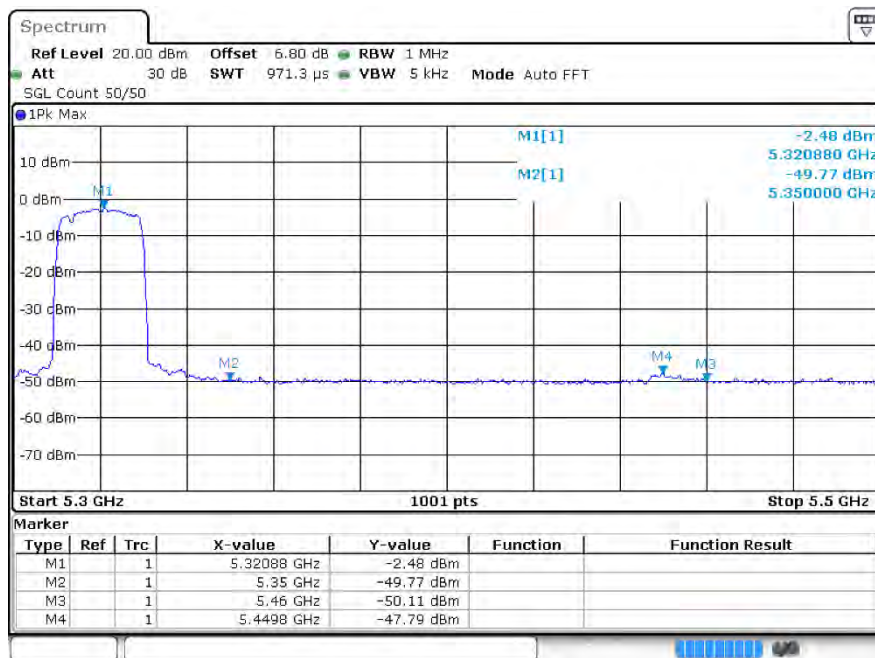


Restrict Bandax20 5500MHz Ant1 Peak

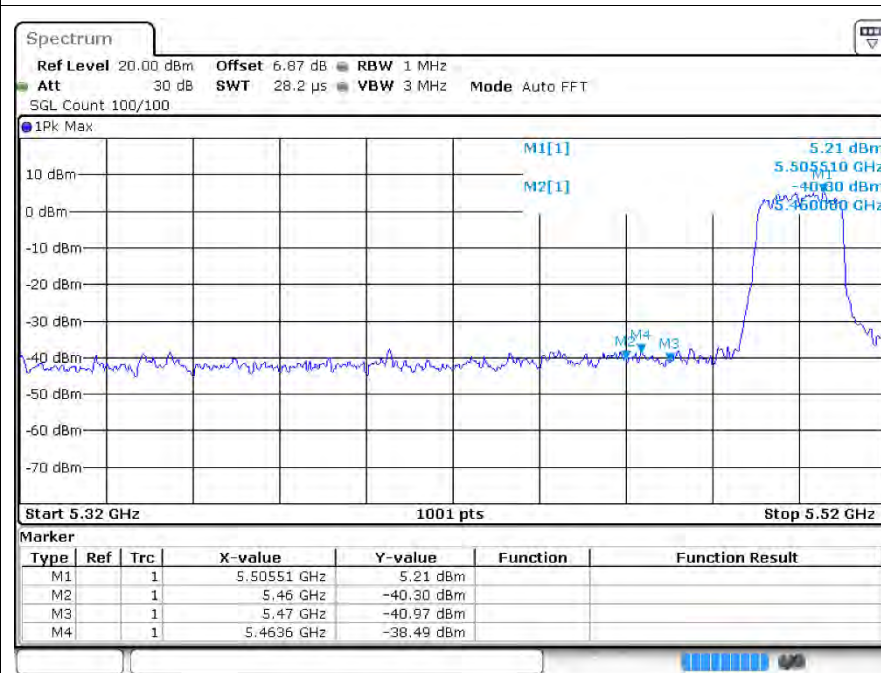


Restrict Band ax20 5500MHz Ant1 Average

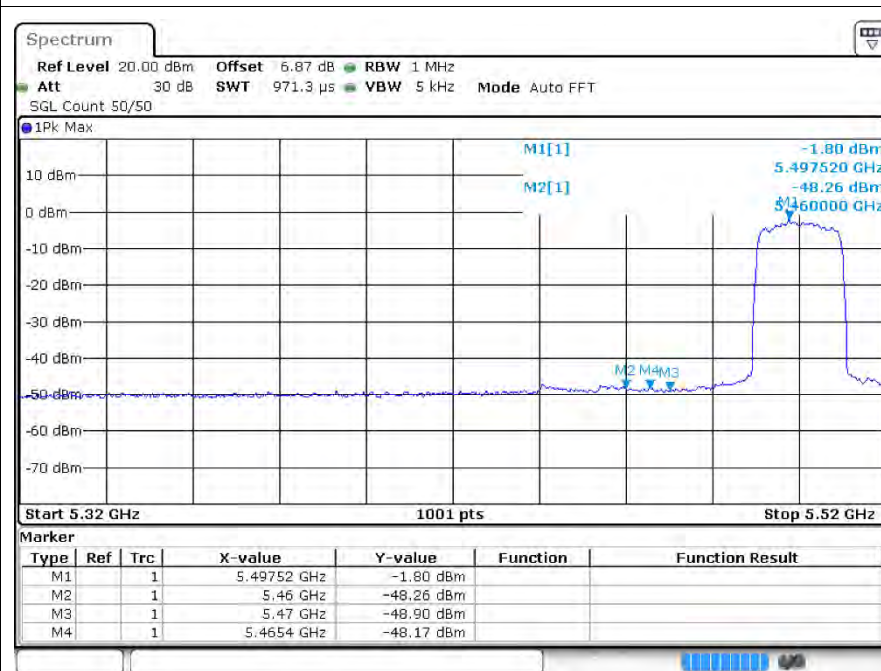


Restrict Bandax20 5700MHz Ant1 Peak

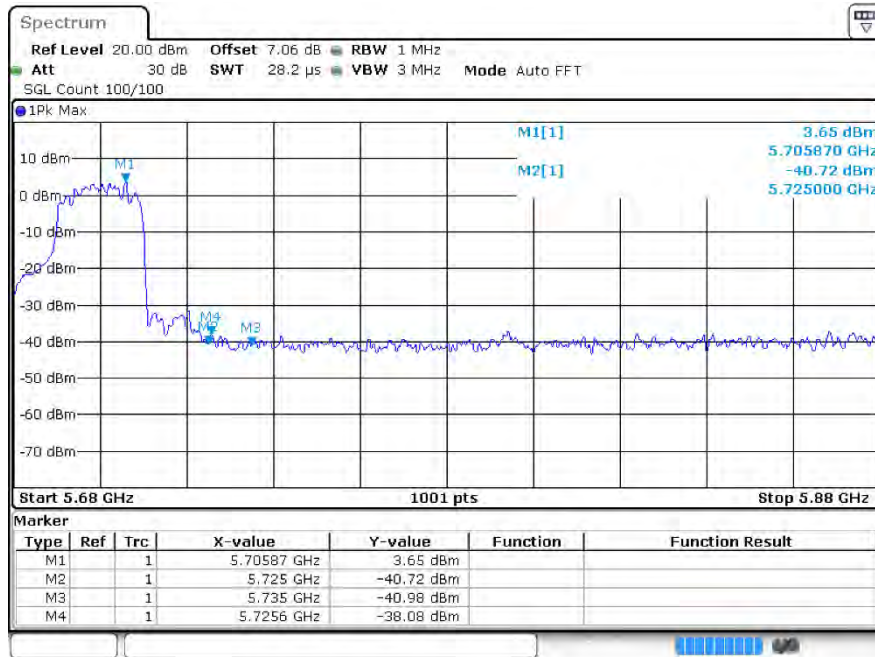


Restrict Band ax20 5700MHz Ant1 Average

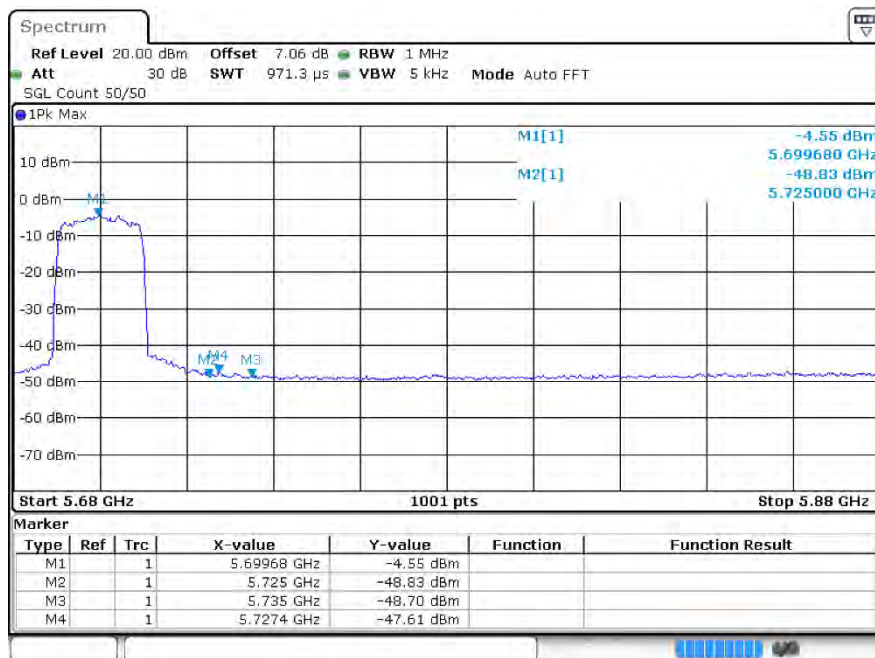


Restrict Bandax40 5190MHz Ant1 Peak

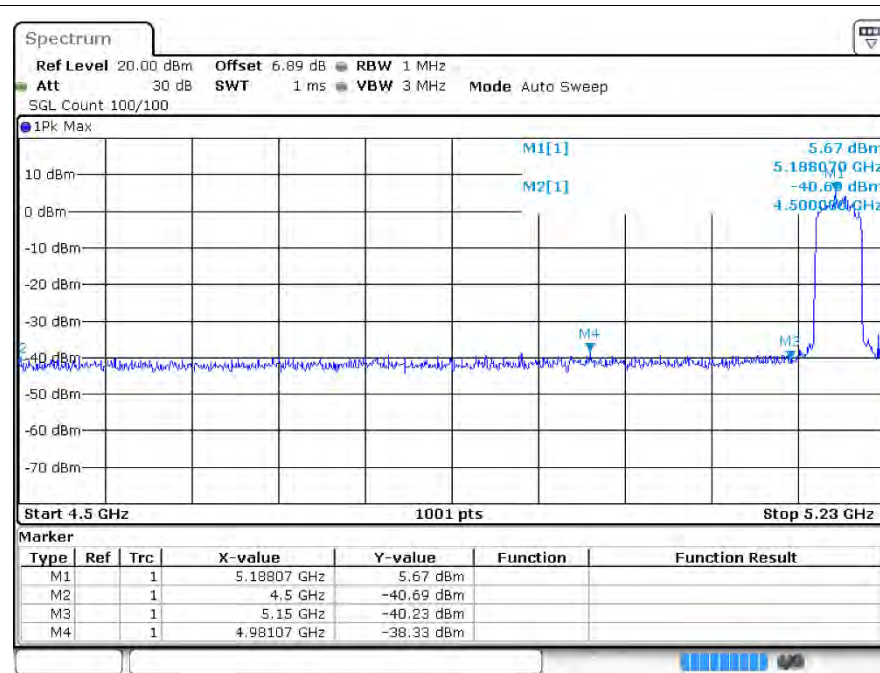


Restrict Band ax40 5190MHz Ant1 Average

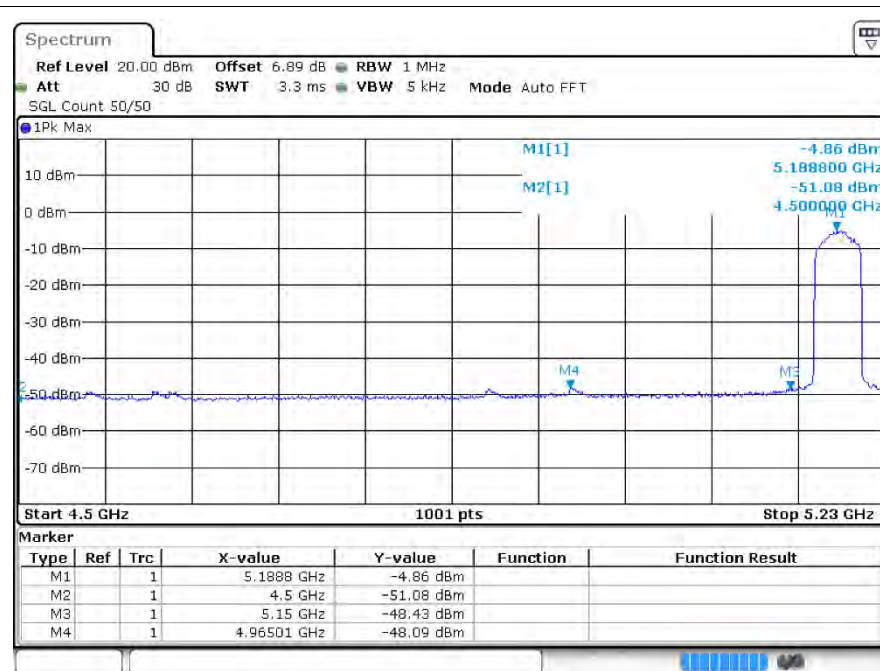


Restrict Bandax40 5230MHz Ant1 Peak

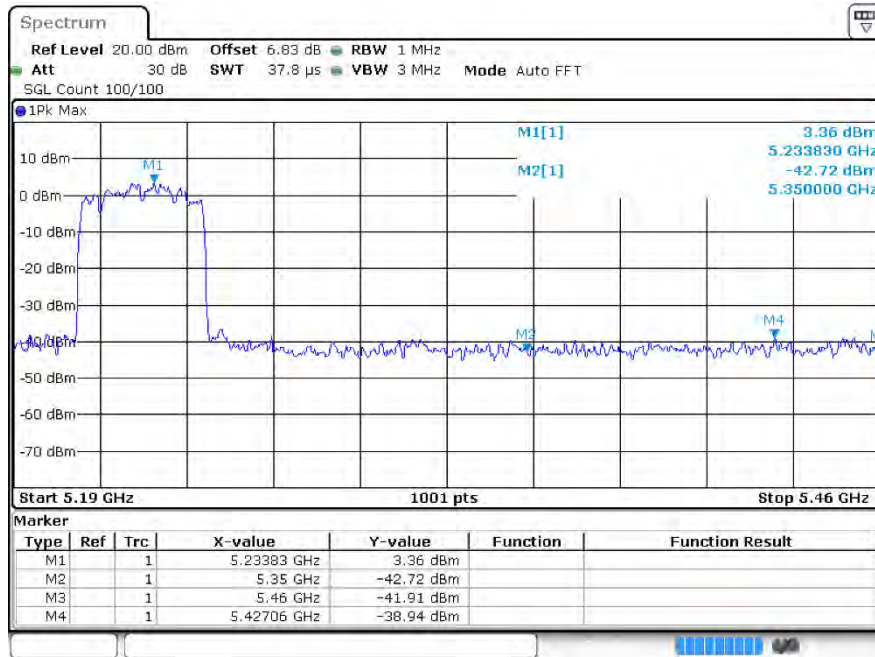


Restrict Band ax40 5230MHz Ant1 Average

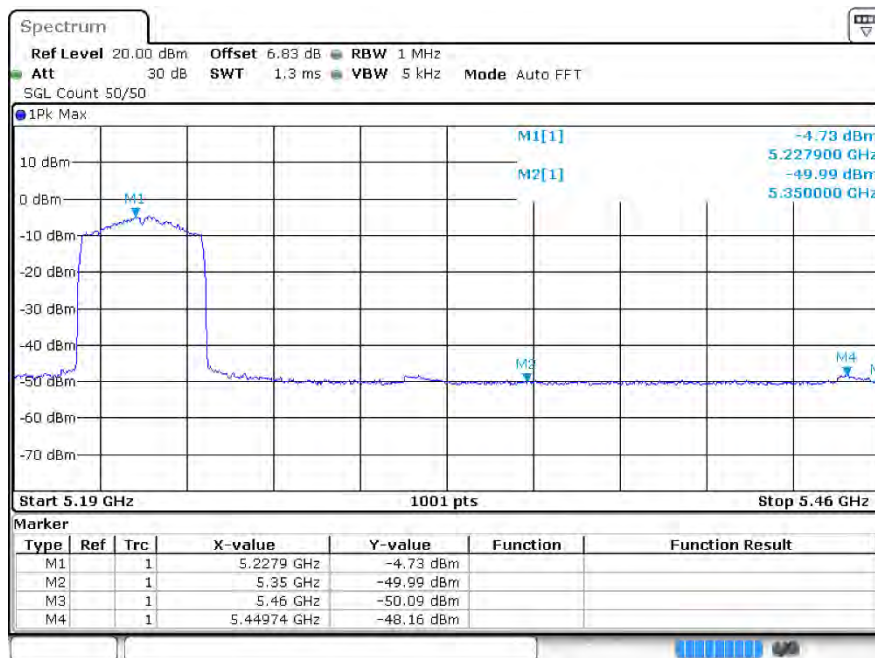


Restrict Bandax40 5270MHz Ant1 Peak

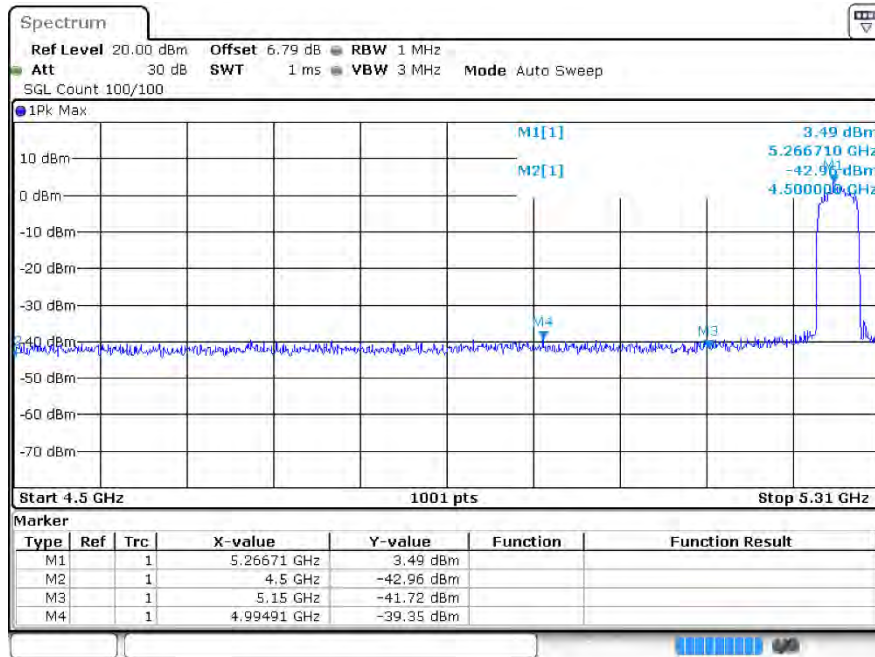


Restrict Band ax40 5270MHz Ant1 Average

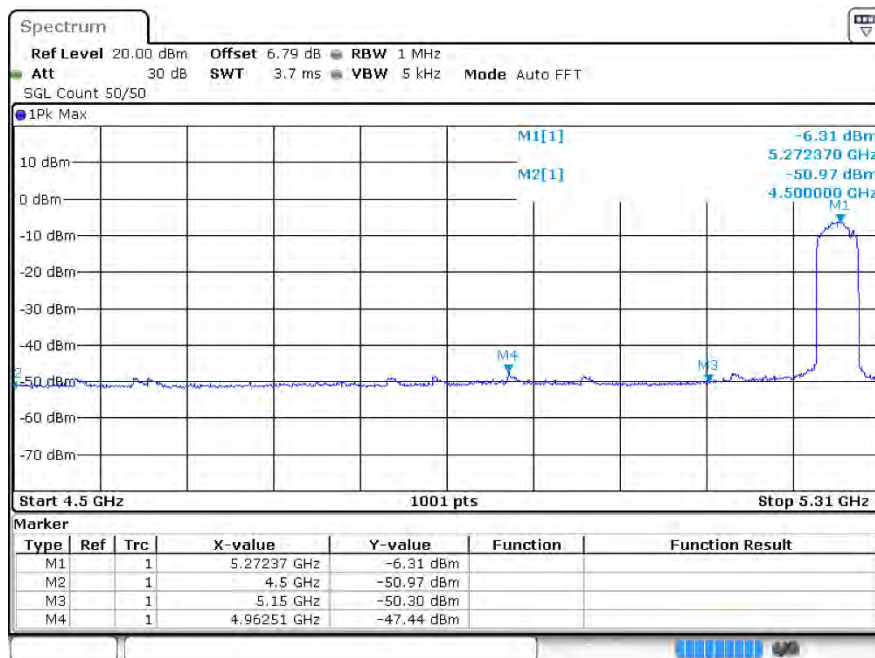


Restrict Bandax40 5310MHz Ant1 Peak

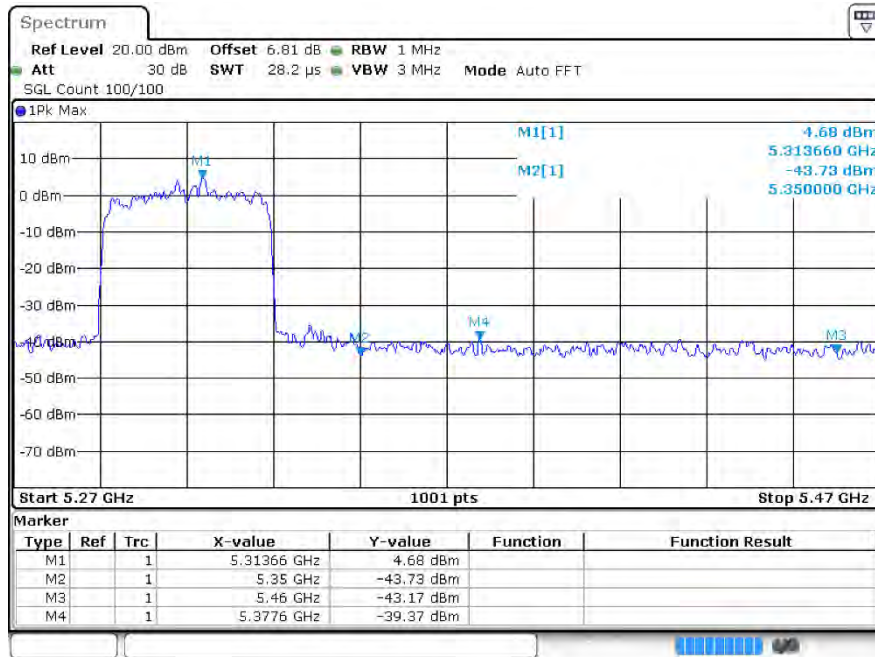


Restrict Band ax40 5310MHz Ant1 Average

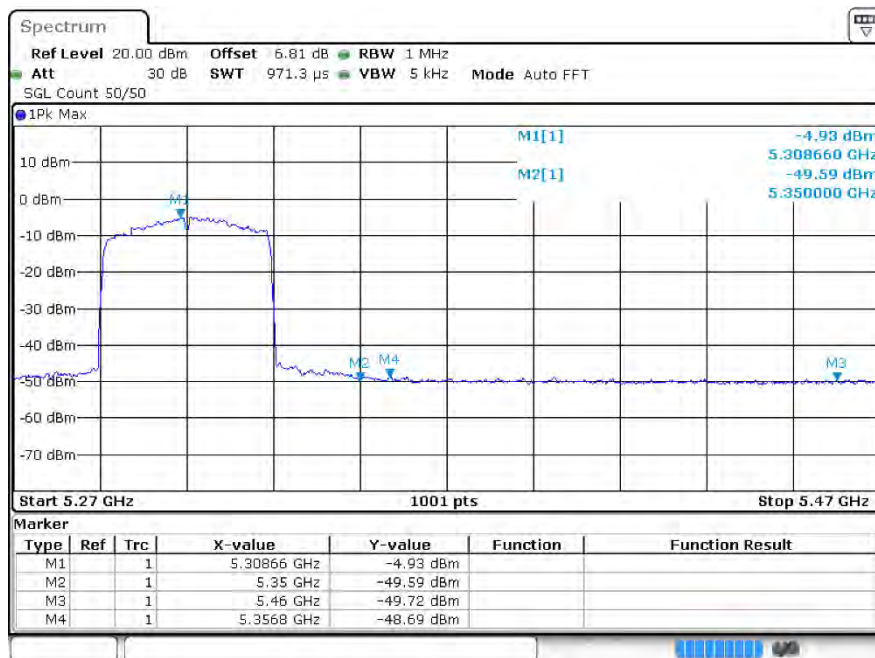


Restrict Bandax40 5510MHz Ant1 Peak

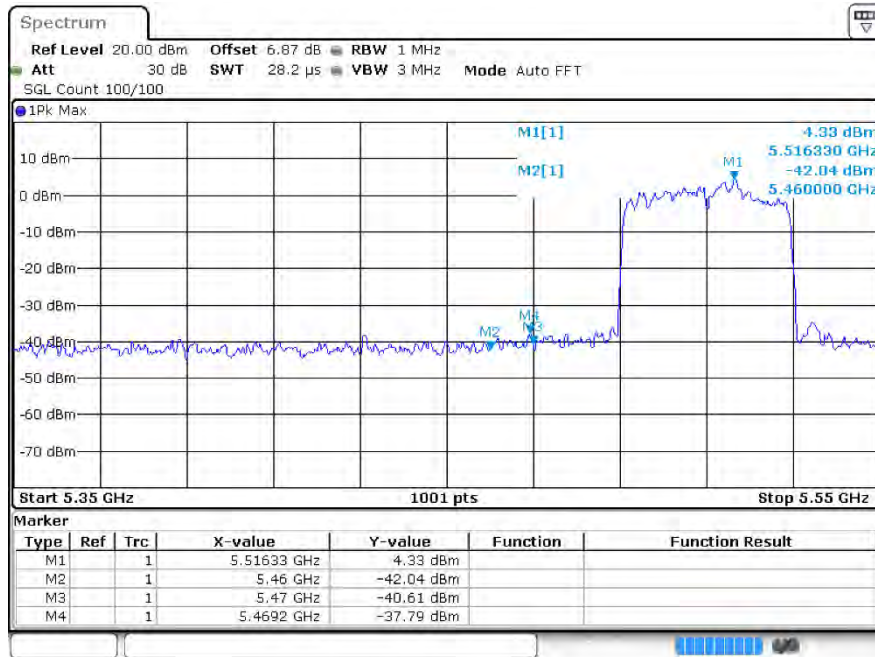

Restrict Band ax40 5510MHz Ant1 Average

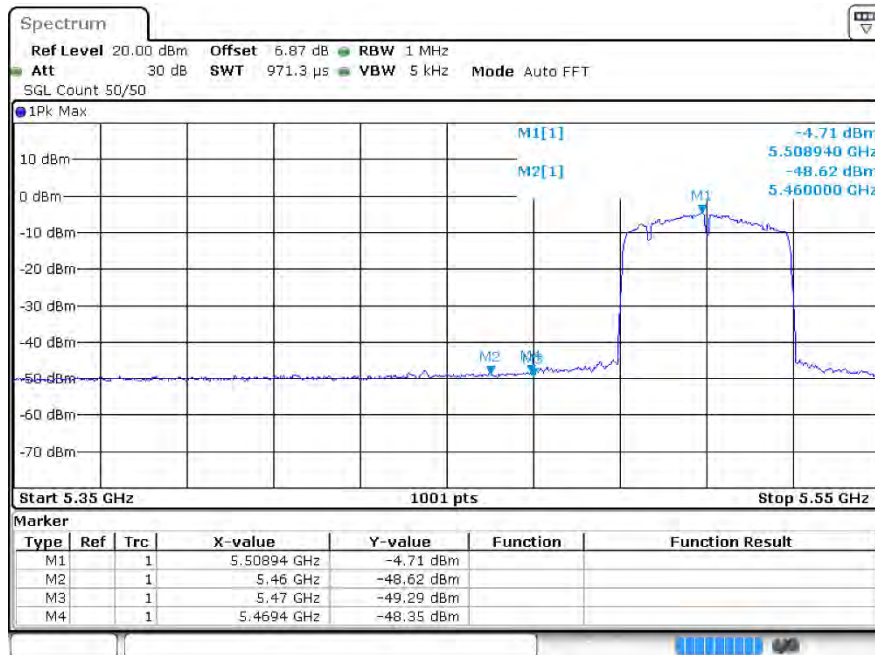


Restrict Bandax40 5670MHz Ant1 Peak

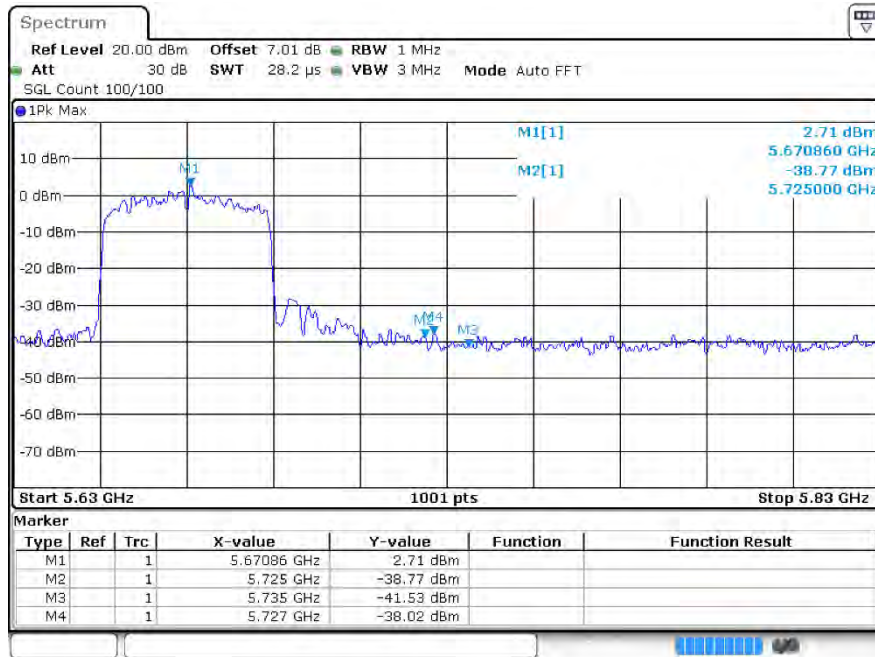


Restrict Band ax40 5670MHz Ant1 Average




Restrict Bandx80 5210MHz Ant1 Peak

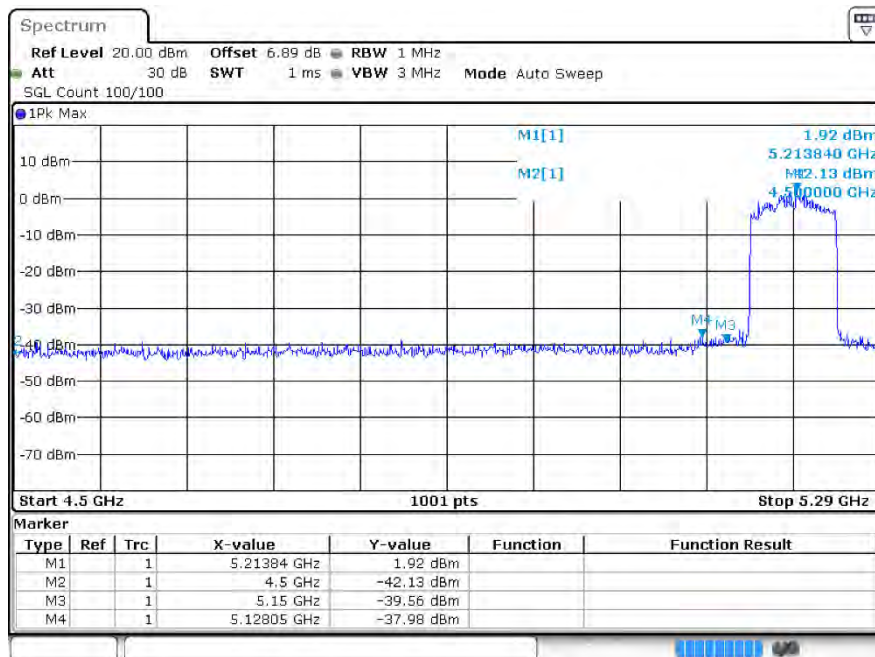


Restrict Band ax80 5210MHz Ant1 Average

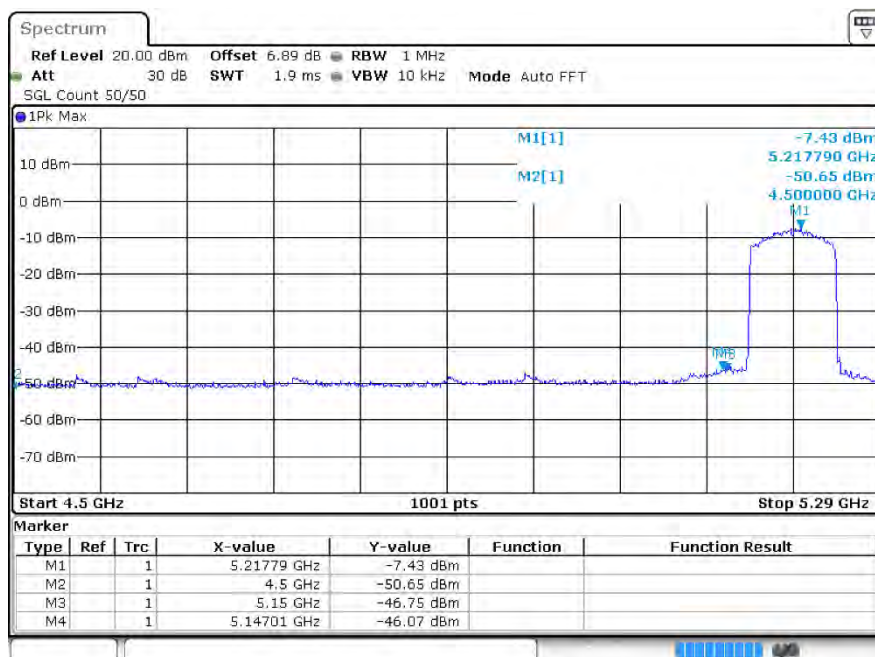


Restrict Bandx80 5290MHz Ant1 Peak

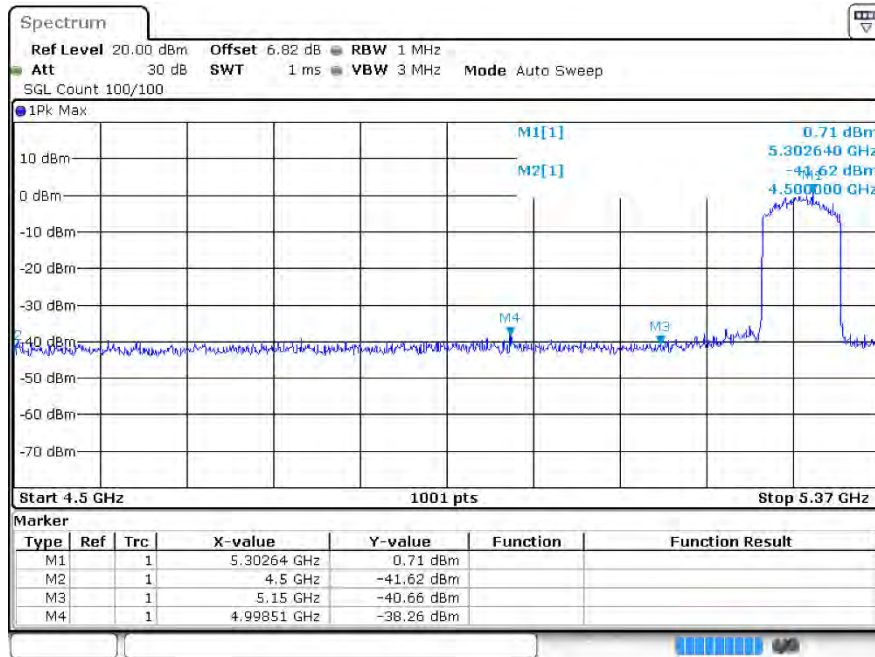

Restrict Band ax80 5290MHz Ant1 Average

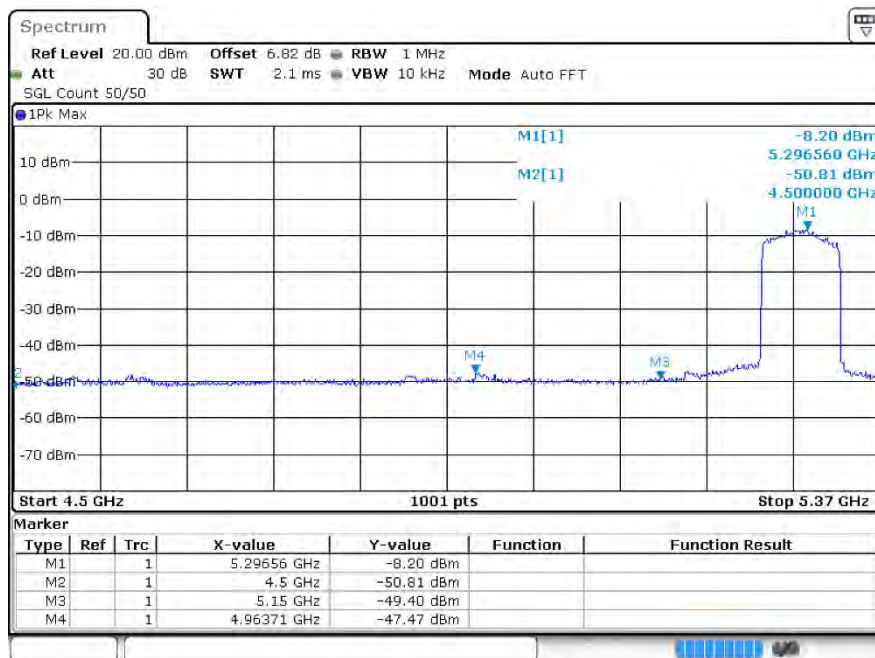

Restrict Bandx80 5530MHz Ant1 Peak

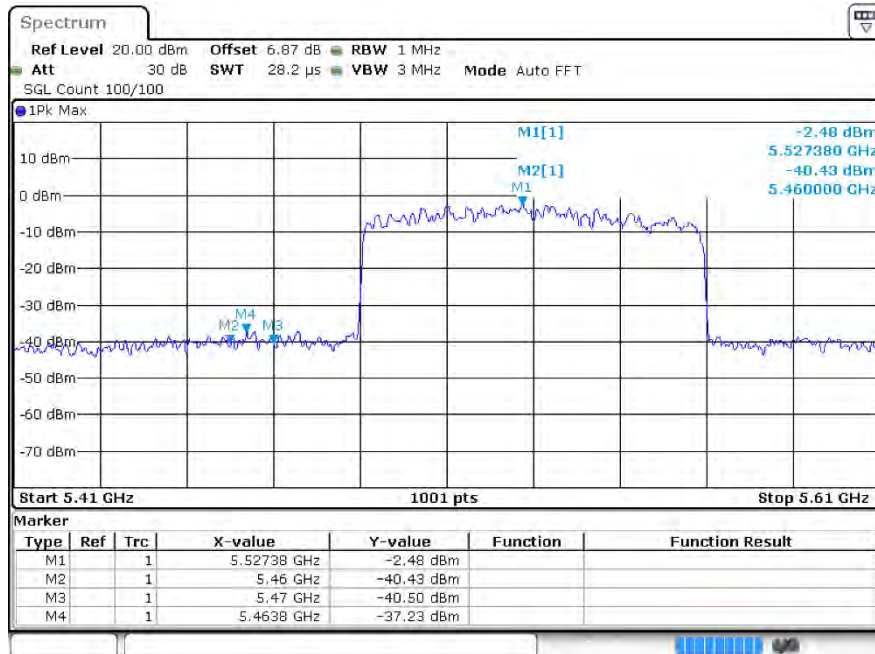

Restrict Band ax80 5530MHz Ant1 Average

