


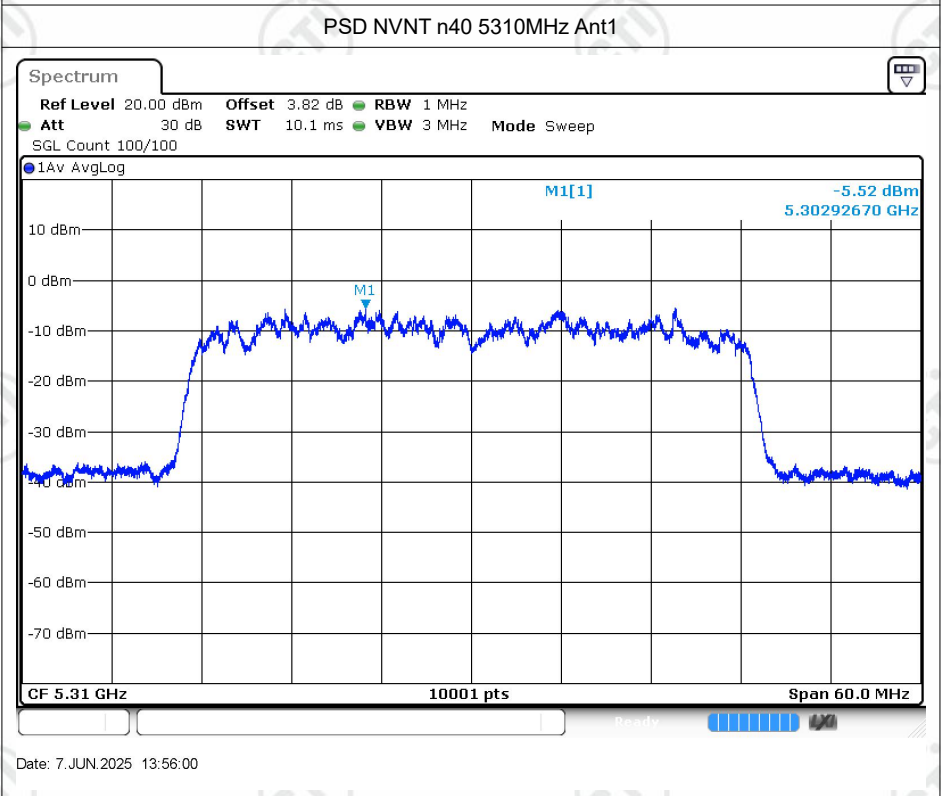


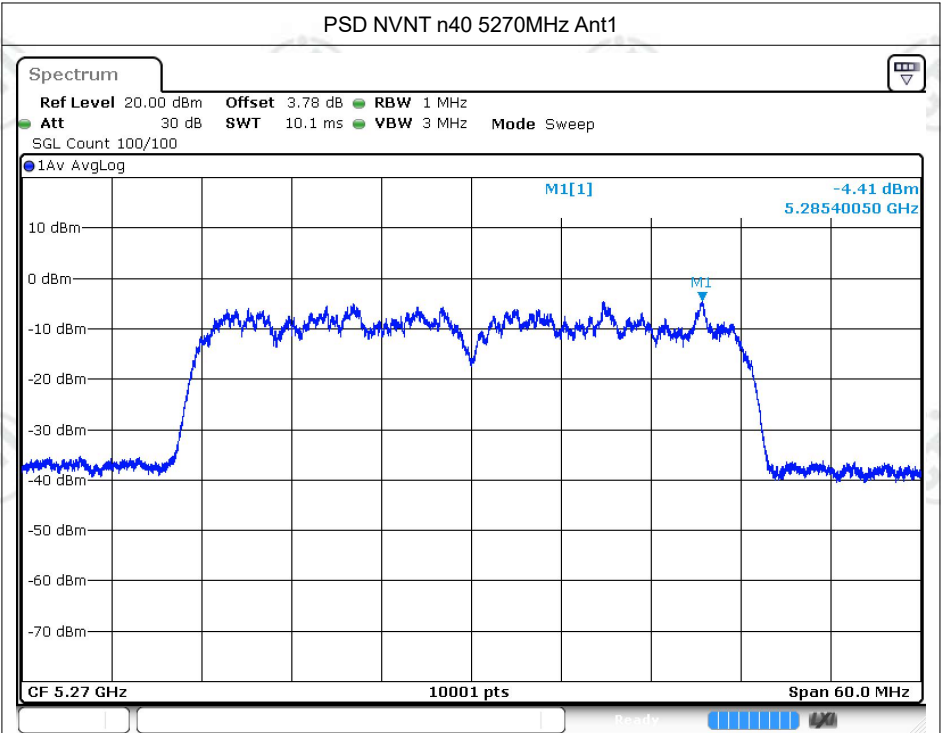


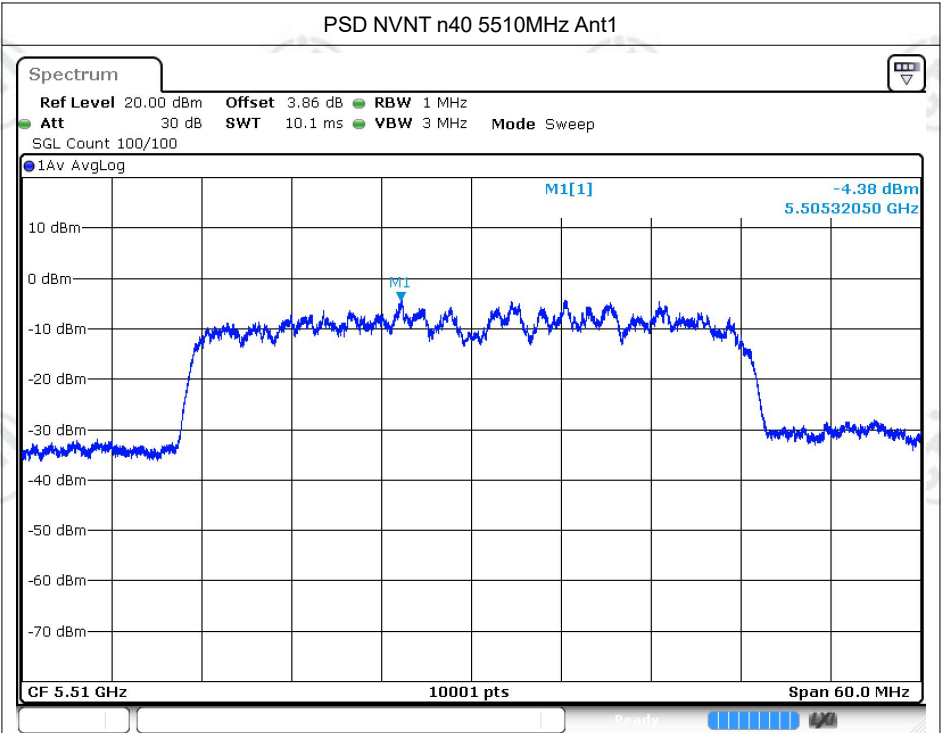


Date: 7 JUN 2025 14:15:24

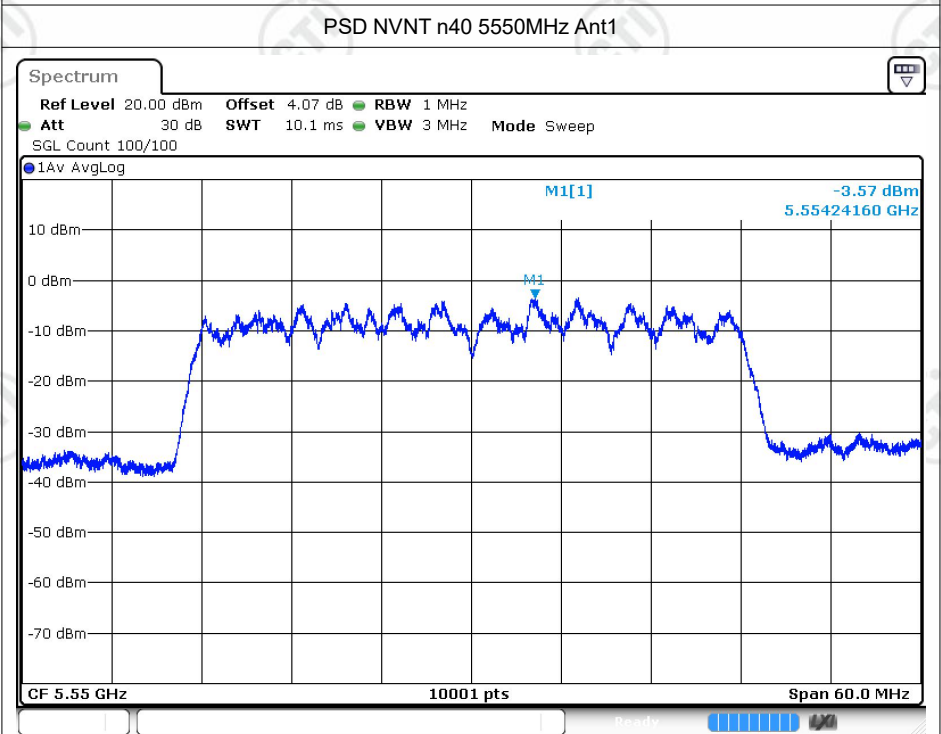


Date: 7 JUN 2025 14:18:06

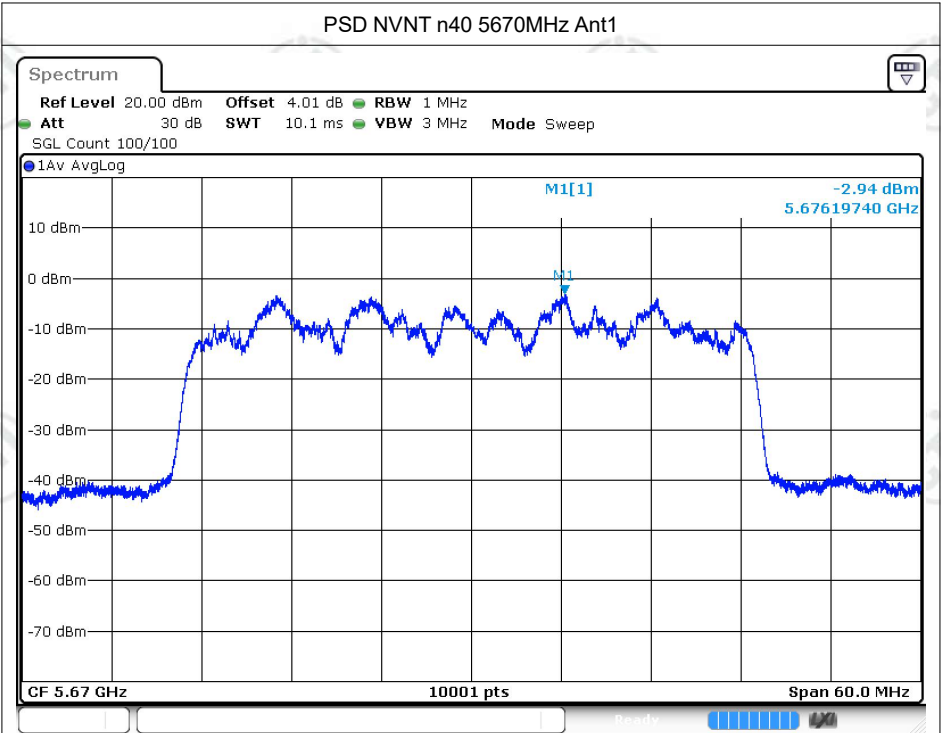

Date: 7 JUN 2025 14:21:06

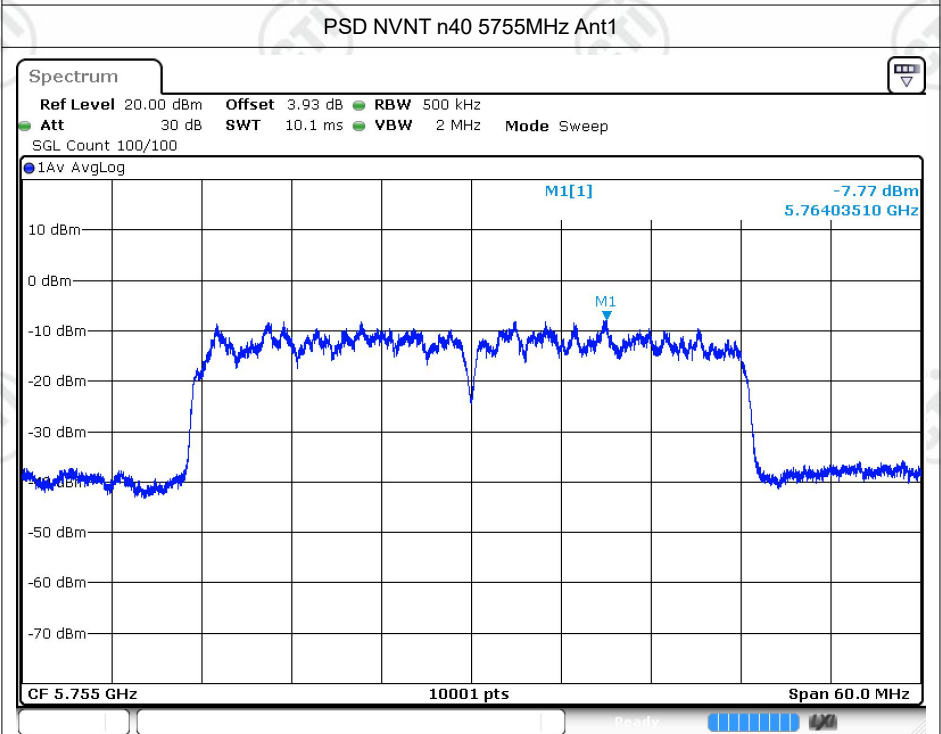

Date: 7 JUN 2025 14:24:15

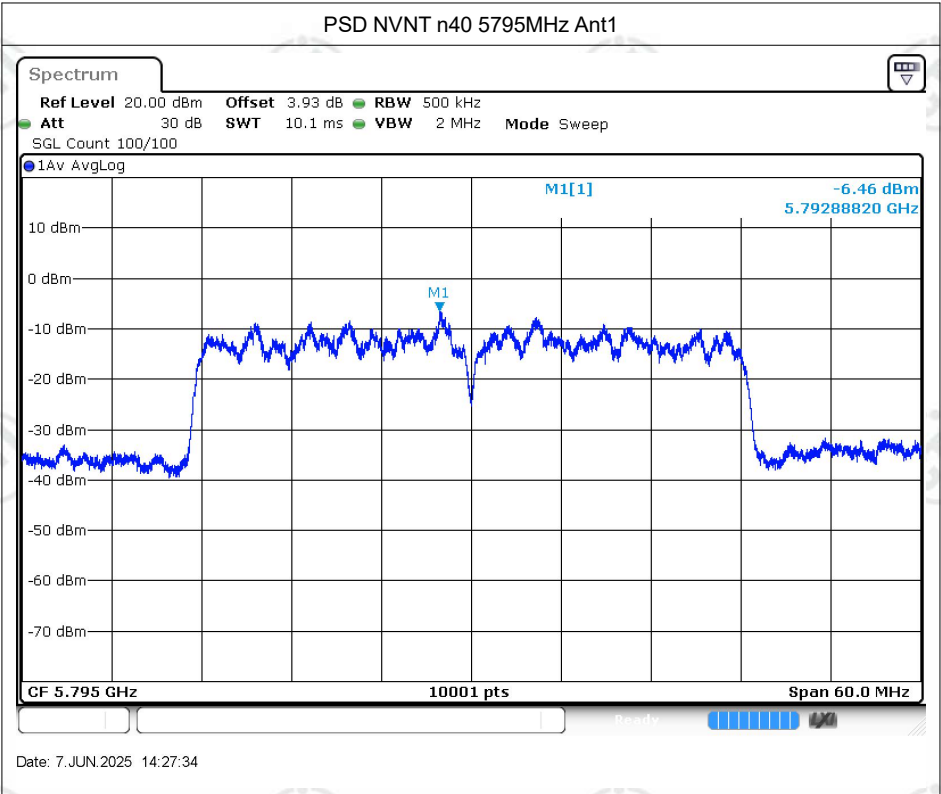

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 120V	a	5180	Ant1	5180	0	0	25	Pass
20C 138V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 120V	a	5180	Ant1	5180	0	0	25	Pass
-10C 120V	a	5180	Ant1	5180	0	0	25	Pass
0C 120V	a	5180	Ant1	5180	0	0	25	Pass
10C 120V	a	5180	Ant1	5180	0	0	25	Pass
30C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
40C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
50C 120V	a	5180	Ant1	5180	0	0	25	Pass
20C 102V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 120V	a	5200	Ant1	5200	0	0	25	Pass
20C 138V	a	5200	Ant1	5200	0	0	25	Pass
-20C 120V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-10C 120V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
0C 120V	a	5200	Ant1	5200.02	20000	3.85	25	Pass
10C 120V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
30C 120V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 120V	a	5200	Ant1	5200.02	20000	3.85	25	Pass
50C 120V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 102V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 138V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-20C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
30C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
50C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 120V	a	5260	Ant1	5260	0	0	25	Pass
20C 138V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 120V	a	5260	Ant1	5260	0	0	25	Pass
-10C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
10C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass

30C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
40C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
50C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 102V	a	5280	Ant1	5280	0	0	25	Pass
20C 120V	a	5280	Ant1	5280	0	0	25	Pass
20C 138V	a	5280	Ant1	5280	0	0	25	Pass
-20C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-10C 120V	a	5280	Ant1	5280	0	0	25	Pass
0C 120V	a	5280	Ant1	5279.96	-40000	-7.58	25	Pass
10C 120V	a	5280	Ant1	5280	0	0	25	Pass
30C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
50C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 102V	a	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 120V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 138V	a	5320	Ant1	5320	0	0	25	Pass
-20C 120V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-10C 120V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
0C 120V	a	5320	Ant1	5320.02	20000	3.76	25	Pass
10C 120V	a	5320	Ant1	5320	0	0	25	Pass
30C 120V	a	5320	Ant1	5320	0	0	25	Pass
40C 120V	a	5320	Ant1	5320	0	0	25	Pass
50C 120V	a	5320	Ant1	5320	0	0	25	Pass
20C 102V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 120V	a	5500	Ant1	5500	0	0	25	Pass
20C 138V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-20C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-10C 120V	a	5500	Ant1	5500.02	20000	3.64	25	Pass
0C 120V	a	5500	Ant1	5500	0	0	25	Pass
10C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
30C 120V	a	5500	Ant1	5500	0	0	25	Pass
40C 120V	a	5500	Ant1	5500	0	0	25	Pass
50C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 102V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
20C 120V	a	5600	Ant1	5600	0	0	25	Pass
20C 138V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
-20C 120V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
-10C 120V	a	5600	Ant1	5600	0	0	25	Pass
0C 120V	a	5600	Ant1	5599.98	-20000	-3.57	25	Pass
10C 120V	a	5600	Ant1	5600.02	20000	3.57	25	Pass
30C 120V	a	5600	Ant1	5600	0	0	25	Pass
40C 120V	a	5600	Ant1	5600	0	0	25	Pass

50C 120V	a	5600	Ant1	5600.02	20000	3.57	25	Pass
20C 102V	a	5700	Ant1	5699.96	-40000	-7.02	25	Pass
20C 120V	a	5700	Ant1	5700	0	0	25	Pass
20C 138V	a	5700	Ant1	5700.02	20000	3.51	25	Pass
-20C 120V	a	5700	Ant1	5700	0	0	25	Pass
-10C 120V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
0C 120V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
10C 120V	a	5700	Ant1	5700	0	0	25	Pass
30C 120V	a	5700	Ant1	5700	0	0	25	Pass
40C 120V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
50C 120V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 102V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 138V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-20C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	a	5745	Ant1	5745	0	0	25	Pass
0C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	a	5745	Ant1	5745	0	0	25	Pass
40C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 120V	a	5745	Ant1	5745	0	0	25	Pass
20C 102V	a	5785	Ant1	5785	0	0	25	Pass
20C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 138V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-20C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-10C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
10C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
30C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	a	5785	Ant1	5784.96	-40000	-6.91	25	Pass
50C 120V	a	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 102V	a	5825	Ant1	5825	0	0	25	Pass
20C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	a	5825	Ant1	5825	0	0	25	Pass
-20C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
0C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	a	5825	Ant1	5825	0	0	25	Pass
30C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass

20C 120V	n20	5180	Ant1	5180	0	0	25	Pass
20C 138V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 120V	n20	5180	Ant1	5180	0	0	25	Pass
30C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
50C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 102V	n20	5200	Ant1	5200.02	20000	3.85	25	Pass
20C 120V	n20	5200	Ant1	5200	0	0	25	Pass
20C 138V	n20	5200	Ant1	5200	0	0	25	Pass
-20C 120V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-10C 120V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
0C 120V	n20	5200	Ant1	5200	0	0	25	Pass
10C 120V	n20	5200	Ant1	5200	0	0	25	Pass
30C 120V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 120V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
50C 120V	n20	5200	Ant1	5200	0	0	25	Pass
20C 102V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 138V	n20	5240	Ant1	5240	0	0	25	Pass
-20C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-10C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
30C 120V	n20	5240	Ant1	5240	0	0	25	Pass
40C 120V	n20	5240	Ant1	5240	0	0	25	Pass
50C 120V	n20	5240	Ant1	5240	0	0	25	Pass
20C 102V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 120V	n20	5260	Ant1	5260	0	0	25	Pass
20C 138V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-10C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 120V	n20	5260	Ant1	5260	0	0	25	Pass
10C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
30C 120V	n20	5260	Ant1	5260.02	20000	3.8	25	Pass
40C 120V	n20	5260	Ant1	5260	0	0	25	Pass
50C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 102V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 138V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass

-20C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-10C 120V	n20	5280	Ant1	5280.02	20000	3.79	25	Pass
0C 120V	n20	5280	Ant1	5280.02	20000	3.79	25	Pass
10C 120V	n20	5280	Ant1	5280	0	0	25	Pass
30C 120V	n20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
40C 120V	n20	5280	Ant1	5280.02	20000	3.79	25	Pass
50C 120V	n20	5280	Ant1	5280	0	0	25	Pass
20C 102V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 138V	n20	5320	Ant1	5320	0	0	25	Pass
-20C 120V	n20	5320	Ant1	5320	0	0	25	Pass
-10C 120V	n20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
0C 120V	n20	5320	Ant1	5320	0	0	25	Pass
10C 120V	n20	5320	Ant1	5320	0	0	25	Pass
30C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
40C 120V	n20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
50C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 102V	n20	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 120V	n20	5500	Ant1	5500	0	0	25	Pass
20C 138V	n20	5500	Ant1	5500	0	0	25	Pass
-20C 120V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-10C 120V	n20	5500	Ant1	5500	0	0	25	Pass
0C 120V	n20	5500	Ant1	5500	0	0	25	Pass
10C 120V	n20	5500	Ant1	5500	0	0	25	Pass
30C 120V	n20	5500	Ant1	5500	0	0	25	Pass
40C 120V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
50C 120V	n20	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 102V	n20	5600	Ant1	5600	0	0	25	Pass
20C 120V	n20	5600	Ant1	5600	0	0	25	Pass
20C 138V	n20	5600	Ant1	5600	0	0	25	Pass
-20C 120V	n20	5600	Ant1	5600	0	0	25	Pass
-10C 120V	n20	5600	Ant1	5600	0	0	25	Pass
0C 120V	n20	5600	Ant1	5599.98	-20000	-3.57	25	Pass
10C 120V	n20	5600	Ant1	5599.98	-20000	-3.57	25	Pass
30C 120V	n20	5600	Ant1	5600	0	0	25	Pass
40C 120V	n20	5600	Ant1	5600	0	0	25	Pass
50C 120V	n20	5600	Ant1	5599.98	-20000	-3.57	25	Pass
20C 102V	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 120V	n20	5700	Ant1	5700	0	0	25	Pass
20C 138V	n20	5700	Ant1	5700	0	0	25	Pass
-20C 120V	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-10C 120V	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass


0C 120V	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
10C 120V	n20	5700	Ant1	5700	0	0	25	Pass
30C 120V	n20	5700	Ant1	5700	0	0	25	Pass
40C 120V	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
50C 120V	n20	5700	Ant1	5700	0	0	25	Pass
20C 102V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 120V	n20	5745	Ant1	5745	0	0	25	Pass
20C 138V	n20	5745	Ant1	5745	0	0	25	Pass
-20C 120V	n20	5745	Ant1	5745	0	0	25	Pass
-10C 120V	n20	5745	Ant1	5745	0	0	25	Pass
0C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 120V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 102V	n20	5785	Ant1	5785	0	0	25	Pass
20C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 138V	n20	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-20C 120V	n20	5785	Ant1	5785	0	0	25	Pass
-10C 120V	n20	5785	Ant1	5785	0	0	25	Pass
0C 120V	n20	5785	Ant1	5785	0	0	25	Pass
10C 120V	n20	5785	Ant1	5785	0	0	25	Pass
30C 120V	n20	5785	Ant1	5785	0	0	25	Pass
40C 120V	n20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
50C 120V	n20	5785	Ant1	5785	0	0	25	Pass
20C 102V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	n20	5825	Ant1	5825	0	0	25	Pass
-20C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	n20	5825	Ant1	5825	0	0	25	Pass
30C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	n20	5825	Ant1	5825	0	0	25	Pass
50C 120V	n20	5825	Ant1	5825	0	0	25	Pass
20C 102V	n40	5190	Ant1	5190	0	0	25	Pass
20C 120V	n40	5190	Ant1	5190	0	0	25	Pass
20C 138V	n40	5190	Ant1	5190	0	0	25	Pass
-20C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-10C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 120V	n40	5190	Ant1	5190	0	0	25	Pass
10C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass

30C 120V	n40	5190	Ant1	5190	0	0	25	Pass
40C 120V	n40	5190	Ant1	5190	0	0	25	Pass
50C 120V	n40	5190	Ant1	5190	0	0	25	Pass
20C 102V	n40	5230	Ant1	5230	0	0	25	Pass
20C 120V	n40	5230	Ant1	5230	0	0	25	Pass
20C 138V	n40	5230	Ant1	5230	0	0	25	Pass
-20C 120V	n40	5230	Ant1	5230	0	0	25	Pass
-10C 120V	n40	5230	Ant1	5230	0	0	25	Pass
0C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
10C 120V	n40	5230	Ant1	5230	0	0	25	Pass
30C 120V	n40	5230	Ant1	5230	0	0	25	Pass
40C 120V	n40	5230	Ant1	5230	0	0	25	Pass
50C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 102V	n40	5270	Ant1	5270	0	0	25	Pass
20C 120V	n40	5270	Ant1	5270	0	0	25	Pass
20C 138V	n40	5270	Ant1	5270	0	0	25	Pass
-20C 120V	n40	5270	Ant1	5270	0	0	25	Pass
-10C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
0C 120V	n40	5270	Ant1	5270	0	0	25	Pass
10C 120V	n40	5270	Ant1	5270	0	0	25	Pass
30C 120V	n40	5270	Ant1	5270	0	0	25	Pass
40C 120V	n40	5270	Ant1	5270	0	0	25	Pass
50C 120V	n40	5270	Ant1	5270	0	0	25	Pass
20C 102V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
20C 120V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
20C 138V	n40	5310	Ant1	5310	0	0	25	Pass
-20C 120V	n40	5310	Ant1	5310	0	0	25	Pass
-10C 120V	n40	5310	Ant1	5310	0	0	25	Pass
0C 120V	n40	5310	Ant1	5310	0	0	25	Pass
10C 120V	n40	5310	Ant1	5310	0	0	25	Pass
30C 120V	n40	5310	Ant1	5310	0	0	25	Pass
40C 120V	n40	5310	Ant1	5310	0	0	25	Pass
50C 120V	n40	5310	Ant1	5310	0	0	25	Pass
20C 102V	n40	5510	Ant1	5510	0	0	25	Pass
20C 120V	n40	5510	Ant1	5510	0	0	25	Pass
20C 138V	n40	5510	Ant1	5510	0	0	25	Pass
-20C 120V	n40	5510	Ant1	5510	0	0	25	Pass
-10C 120V	n40	5510	Ant1	5510	0	0	25	Pass
0C 120V	n40	5510	Ant1	5510	0	0	25	Pass
10C 120V	n40	5510	Ant1	5510	0	0	25	Pass
30C 120V	n40	5510	Ant1	5510	0	0	25	Pass
40C 120V	n40	5510	Ant1	5510	0	0	25	Pass


50C 120V	n40	5510	Ant1	5510	0	0	25	Pass
20C 102V	n40	5550	Ant1	5550	0	0	25	Pass
20C 120V	n40	5550	Ant1	5550	0	0	25	Pass
20C 138V	n40	5550	Ant1	5550	0	0	25	Pass
-20C 120V	n40	5550	Ant1	5550	0	0	25	Pass
-10C 120V	n40	5550	Ant1	5550	0	0	25	Pass
0C 120V	n40	5550	Ant1	5550	0	0	25	Pass
10C 120V	n40	5550	Ant1	5550	0	0	25	Pass
30C 120V	n40	5550	Ant1	5550	0	0	25	Pass
40C 120V	n40	5550	Ant1	5550	0	0	25	Pass
50C 120V	n40	5550	Ant1	5550	0	0	25	Pass
20C 102V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
20C 120V	n40	5670	Ant1	5670	0	0	25	Pass
20C 138V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
-20C 120V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
-10C 120V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
0C 120V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
10C 120V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
30C 120V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
40C 120V	n40	5670	Ant1	5670	0	0	25	Pass
50C 120V	n40	5670	Ant1	5669.92	-80000	-14.11	25	Pass
20C 102V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-20C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
0C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
30C 120V	n40	5755	Ant1	5754.92	-80000	-13.9	25	Pass
40C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	n40	5755	Ant1	5755	0	0	25	Pass
20C 102V	n40	5795	Ant1	5795	0	0	25	Pass
20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 138V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
-20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
0C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
30C 120V	n40	5795	Ant1	5795	0	0	25	Pass
40C 120V	n40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
50C 120V	n40	5795	Ant1	5795	0	0	25	Pass

-6dB Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	-6 dB Bandwidth (MHz)	Limit -6 dB Bandwidth (MHz)	Verdict
NVNT	a	5745	Ant1	16.278	0.5	Pass
NVNT	a	5785	Ant1	16.296	0.5	Pass
NVNT	a	5825	Ant1	16.032	0.5	Pass
NVNT	n20	5745	Ant1	16.917	0.5	Pass
NVNT	n20	5785	Ant1	17.01	0.5	Pass
NVNT	n20	5825	Ant1	16.923	0.5	Pass
NVNT	n40	5755	Ant1	35.058	0.5	Pass
NVNT	n40	5795	Ant1	35.046	0.5	Pass

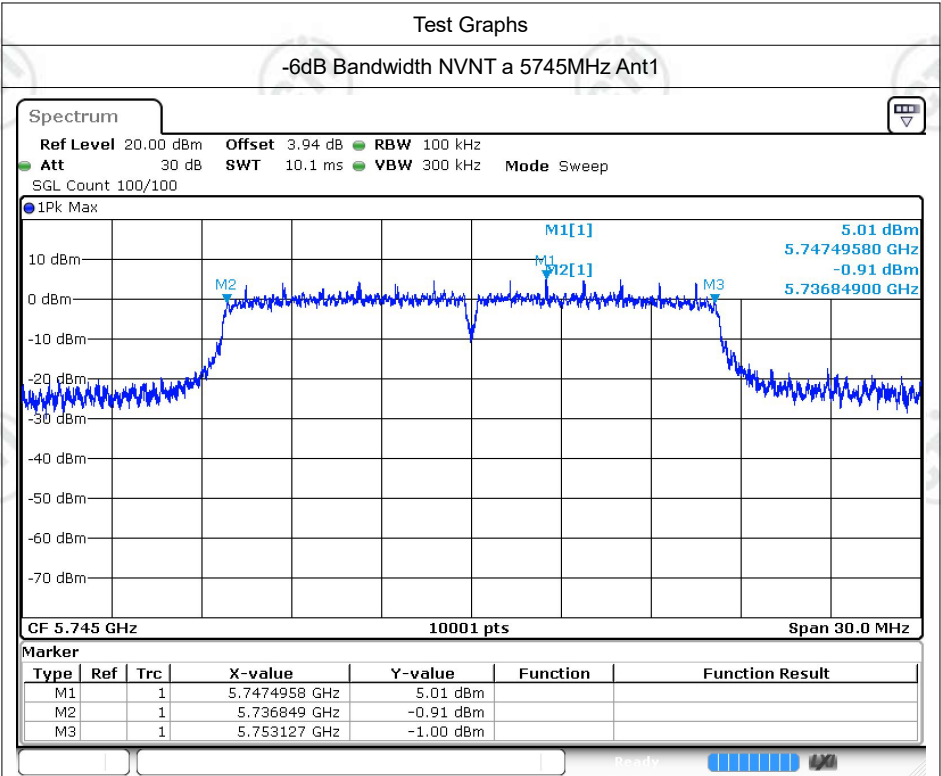


Date: 7.JUN.2025 12:54:28

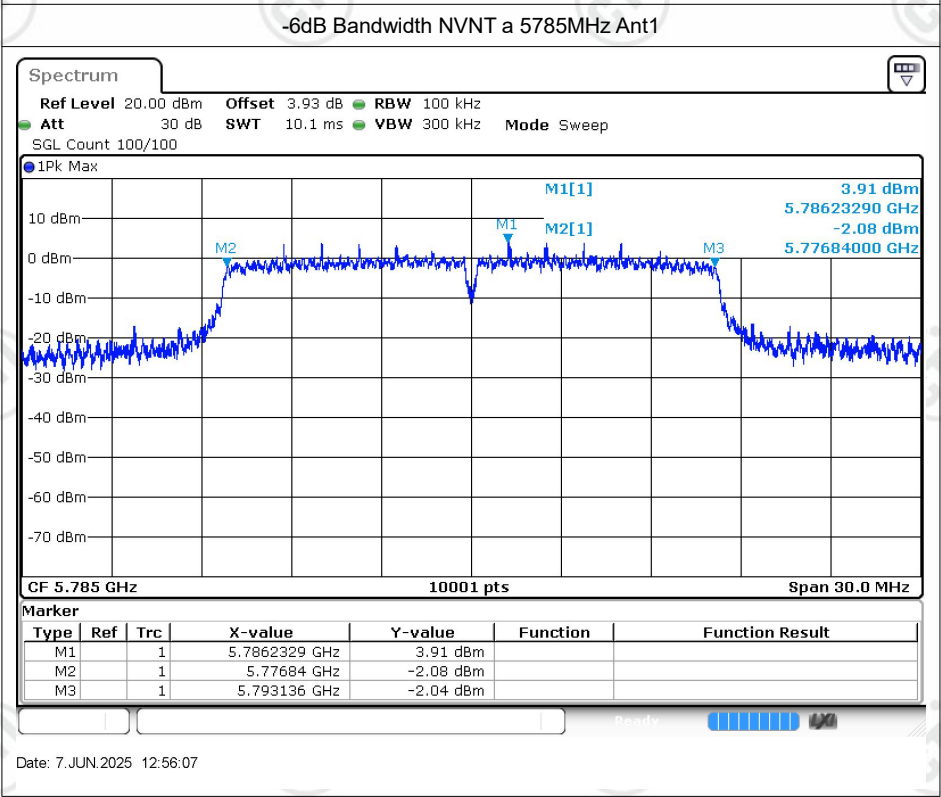


Date: 7.JUN.2025 12:56:07

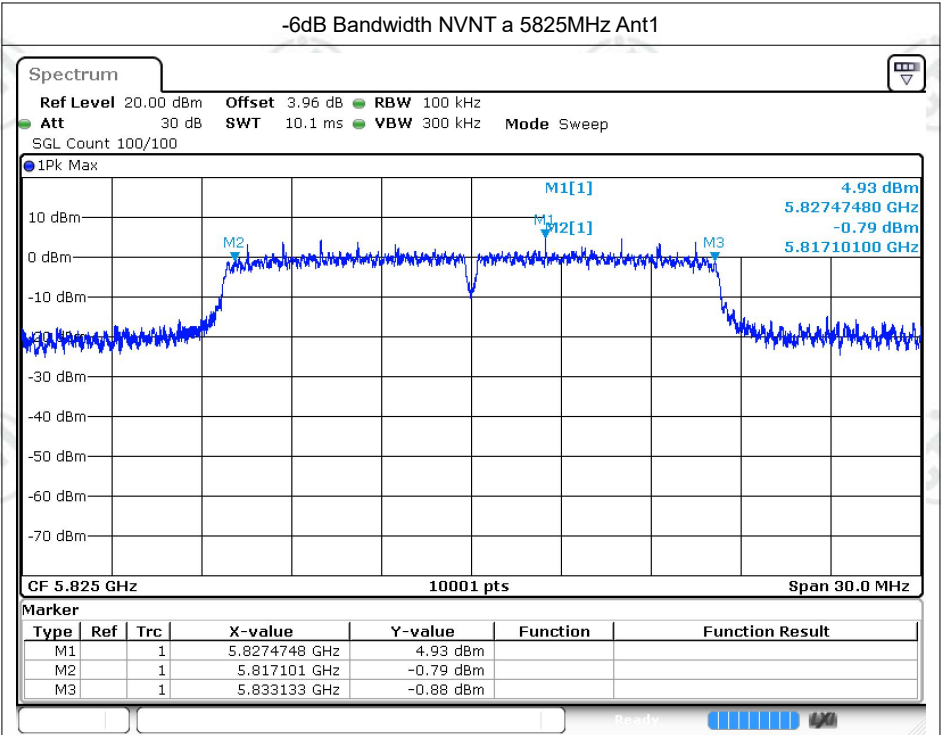


Date: 7.JUN.2025 12:59:51

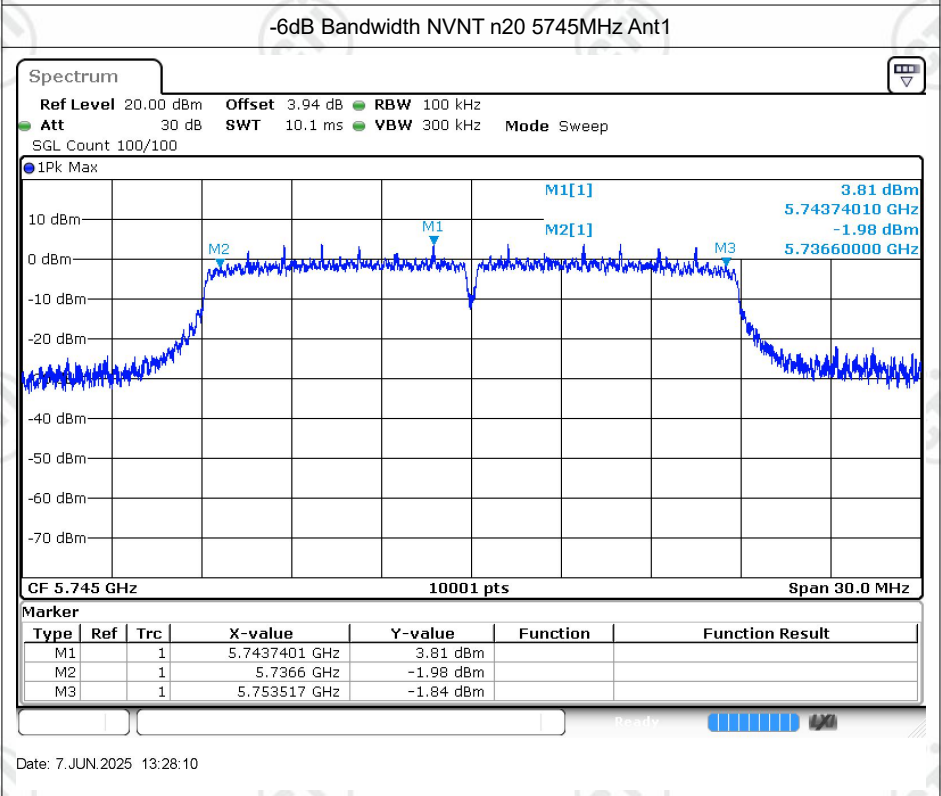


Date: 7.JUN.2025 13:28:10

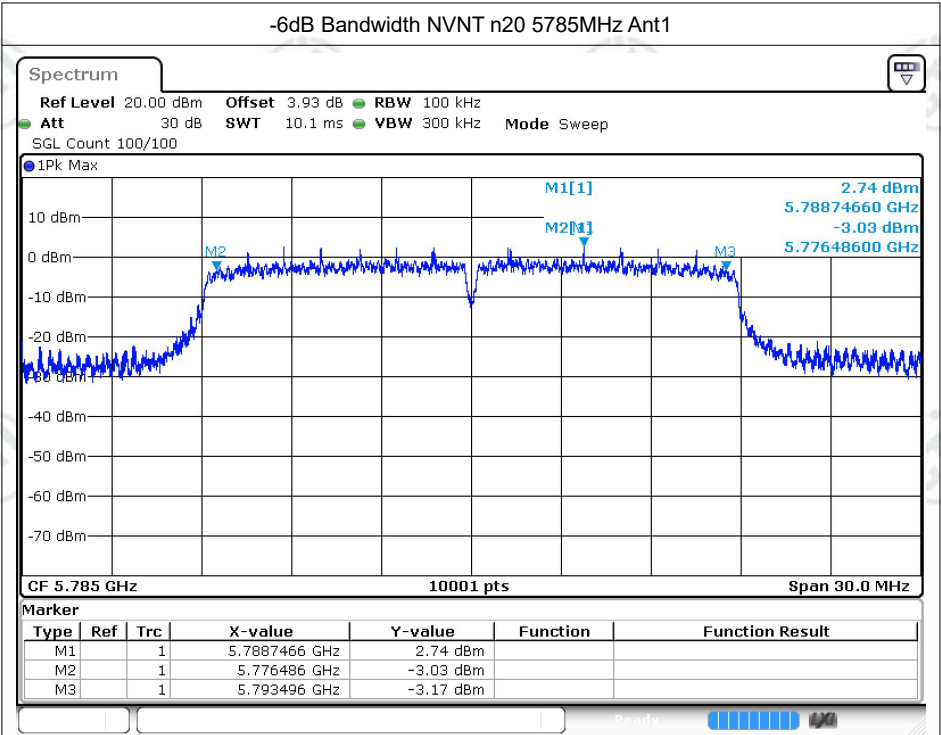


Date: 7 JUN 2025 13:29:52

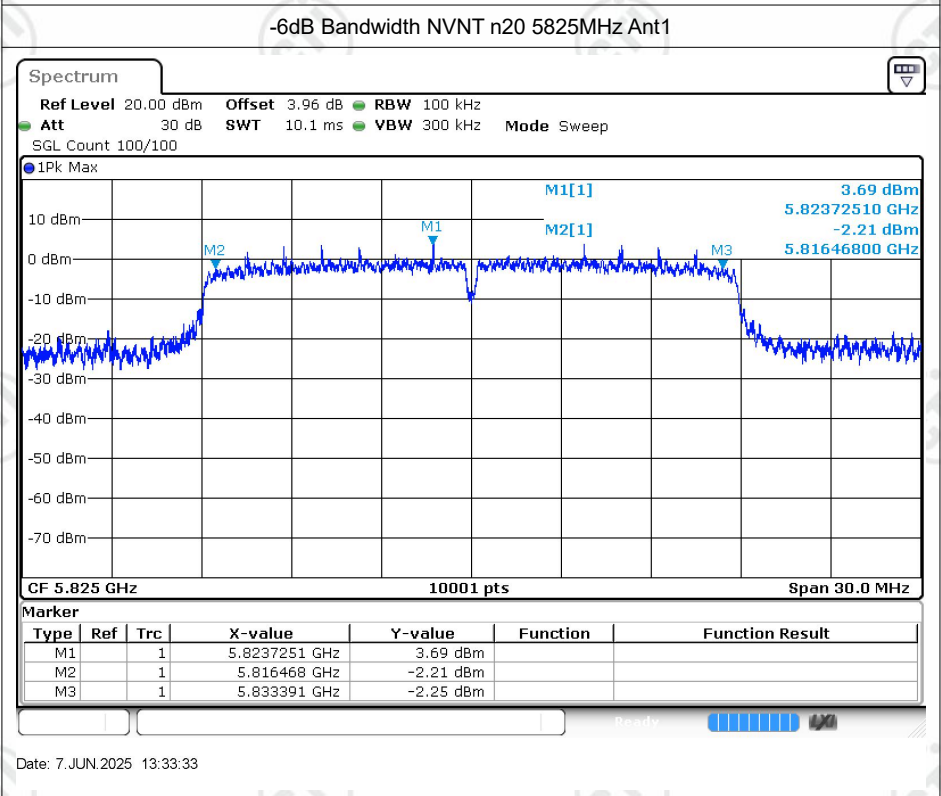

Date: 7 JUN 2025 13:33:33

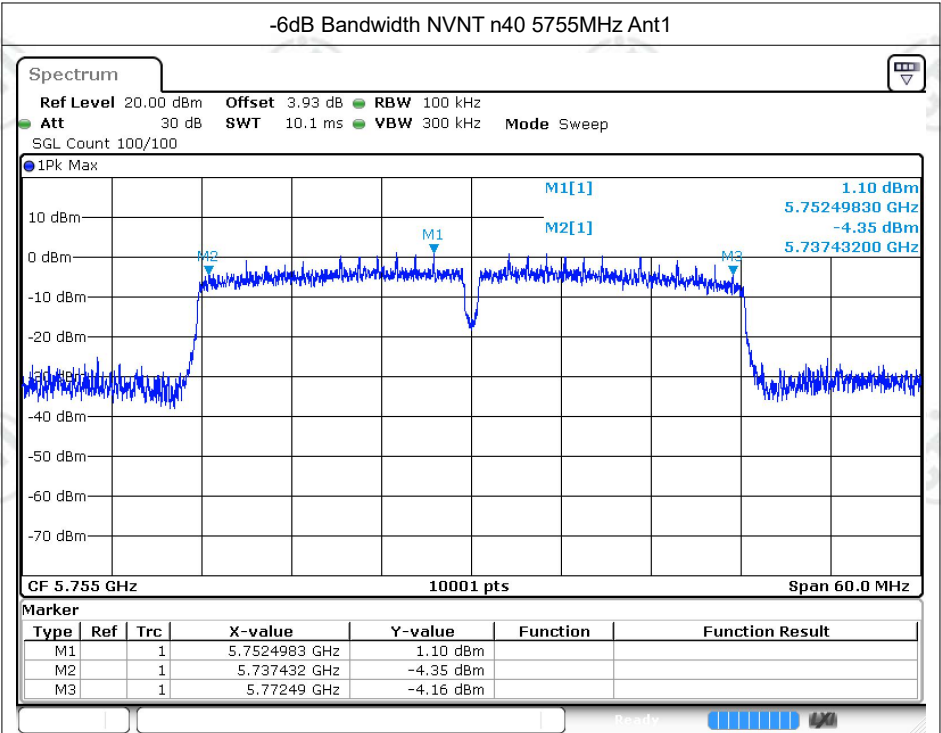

Date: 7 JUN 2025 14:24:11

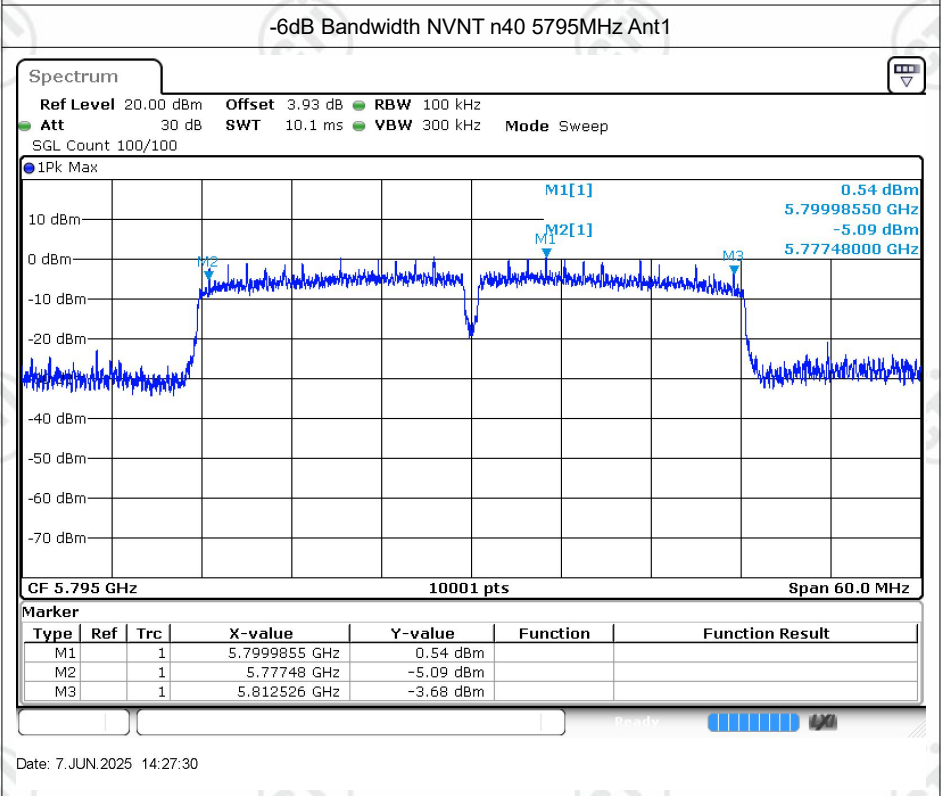

Date: 7 JUN 2025 14:27:30

*** End of Report ***