

Appendix Test Data

Report No.:	1812C50309512504	Test Sample No.:	1-2-2
Start Test Date:	2025-07-03	Finish Test Date:	2025-07-03
Test Engineer:	<i>Alex Peng</i>	Auditor:	<i>Justin Feng</i>
Temperature:	23,3°C	Relative Humidity:	52%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	18.240	5170.880	5189.120	---	---
11A	Ant2	5180	18.040	5171.000	5189.040	---	---
11A	Ant1	5220	18.120	5210.960	5229.080	---	---
11A	Ant2	5220	18.040	5211.000	5229.040	---	---
11A	Ant1	5240	18.080	5231.000	5249.080	---	---
11A	Ant2	5240	18.120	5230.960	5249.080	---	---
11A	Ant1	5745	18.080	5736.000	5754.080	---	---
11A	Ant2	5745	18.040	5736.040	5754.080	---	---
11A	Ant1	5785	18.080	5776.000	5794.080	---	---
11A	Ant2	5785	18.040	5776.040	5794.080	---	---
11A	Ant1	5825	18.080	5815.960	5834.040	---	---
11A	Ant2	5825	18.080	5815.960	5834.040	---	---
11N20MIMO	Ant1	5180	19.440	5170.240	5189.680	---	---
11N20MIMO	Ant2	5180	19.280	5170.360	5189.640	---	---
11N20MIMO	Ant1	5220	19.480	5210.240	5229.720	---	---
11N20MIMO	Ant2	5220	19.400	5210.320	5229.720	---	---
11N20MIMO	Ant1	5240	19.400	5230.280	5249.680	---	---
11N20MIMO	Ant2	5240	19.360	5230.280	5249.640	---	---
11N20MIMO	Ant1	5745	19.400	5735.280	5754.680	---	---
11N20MIMO	Ant2	5745	19.400	5735.320	5754.720	---	---
11N20MIMO	Ant1	5785	19.400	5775.280	5794.680	---	---
11N20MIMO	Ant2	5785	19.320	5775.360	5794.680	---	---


11N20MIMO	Ant1	5825	19.400	5815.280	5834.680	---	---
11N20MIMO	Ant2	5825	19.440	5815.240	5834.680	---	---
11N40MIMO	Ant1	5190	38.800	5170.800	5209.600	---	---
11N40MIMO	Ant2	5190	38.800	5170.800	5209.600	---	---
11N40MIMO	Ant1	5230	38.880	5210.800	5249.680	---	---
11N40MIMO	Ant2	5230	38.880	5210.720	5249.600	---	---
11N40MIMO	Ant1	5755	38.800	5735.800	5774.600	---	---
11N40MIMO	Ant2	5755	38.880	5735.720	5774.600	---	---
11N40MIMO	Ant1	5795	38.880	5775.720	5814.600	---	---
11N40MIMO	Ant2	5795	38.960	5775.720	5814.680	---	---
11AC20MIMO	Ant1	5180	19.480	5170.280	5189.760	---	---
11AC20MIMO	Ant2	5180	19.400	5170.280	5189.680	---	---
11AC20MIMO	Ant1	5220	19.480	5210.200	5229.680	---	---
11AC20MIMO	Ant2	5220	19.240	5210.400	5229.640	---	---
11AC20MIMO	Ant1	5240	19.360	5230.320	5249.680	---	---
11AC20MIMO	Ant2	5240	19.360	5230.320	5249.680	---	---
11AC20MIMO	Ant1	5745	19.440	5735.240	5754.680	---	---
11AC20MIMO	Ant2	5745	19.440	5735.240	5754.680	---	---
11AC20MIMO	Ant1	5785	19.400	5775.280	5794.680	---	---
11AC20MIMO	Ant2	5785	19.400	5775.280	5794.680	---	---
11AC20MIMO	Ant1	5825	19.400	5815.280	5834.680	---	---
11AC20MIMO	Ant2	5825	19.320	5815.360	5834.680	---	---
11AC40MIMO	Ant1	5190	38.720	5170.720	5209.440	---	---
11AC40MIMO	Ant2	5190	39.040	5170.720	5209.760	---	---
11AC40MIMO	Ant1	5230	38.960	5210.640	5249.600	---	---
11AC40MIMO	Ant2	5230	38.880	5210.720	5249.600	---	---
11AC40MIMO	Ant1	5755	39.040	5735.640	5774.680	---	---
11AC40MIMO	Ant2	5755	38.960	5735.720	5774.680	---	---
11AC40MIMO	Ant1	5795	38.960	5775.640	5814.600	---	---
11AC40MIMO	Ant2	5795	39.040	5775.640	5814.680	---	---
11AC80MIMO	Ant1	5210	84.960	5166.960	5251.920	---	---
11AC80MIMO	Ant2	5210	84.800	5167.120	5251.920	---	---
11AC80MIMO	Ant1	5775	84.640	5732.120	5816.760	---	---
11AC80MIMO	Ant2	5775	85.120	5731.960	5817.080	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

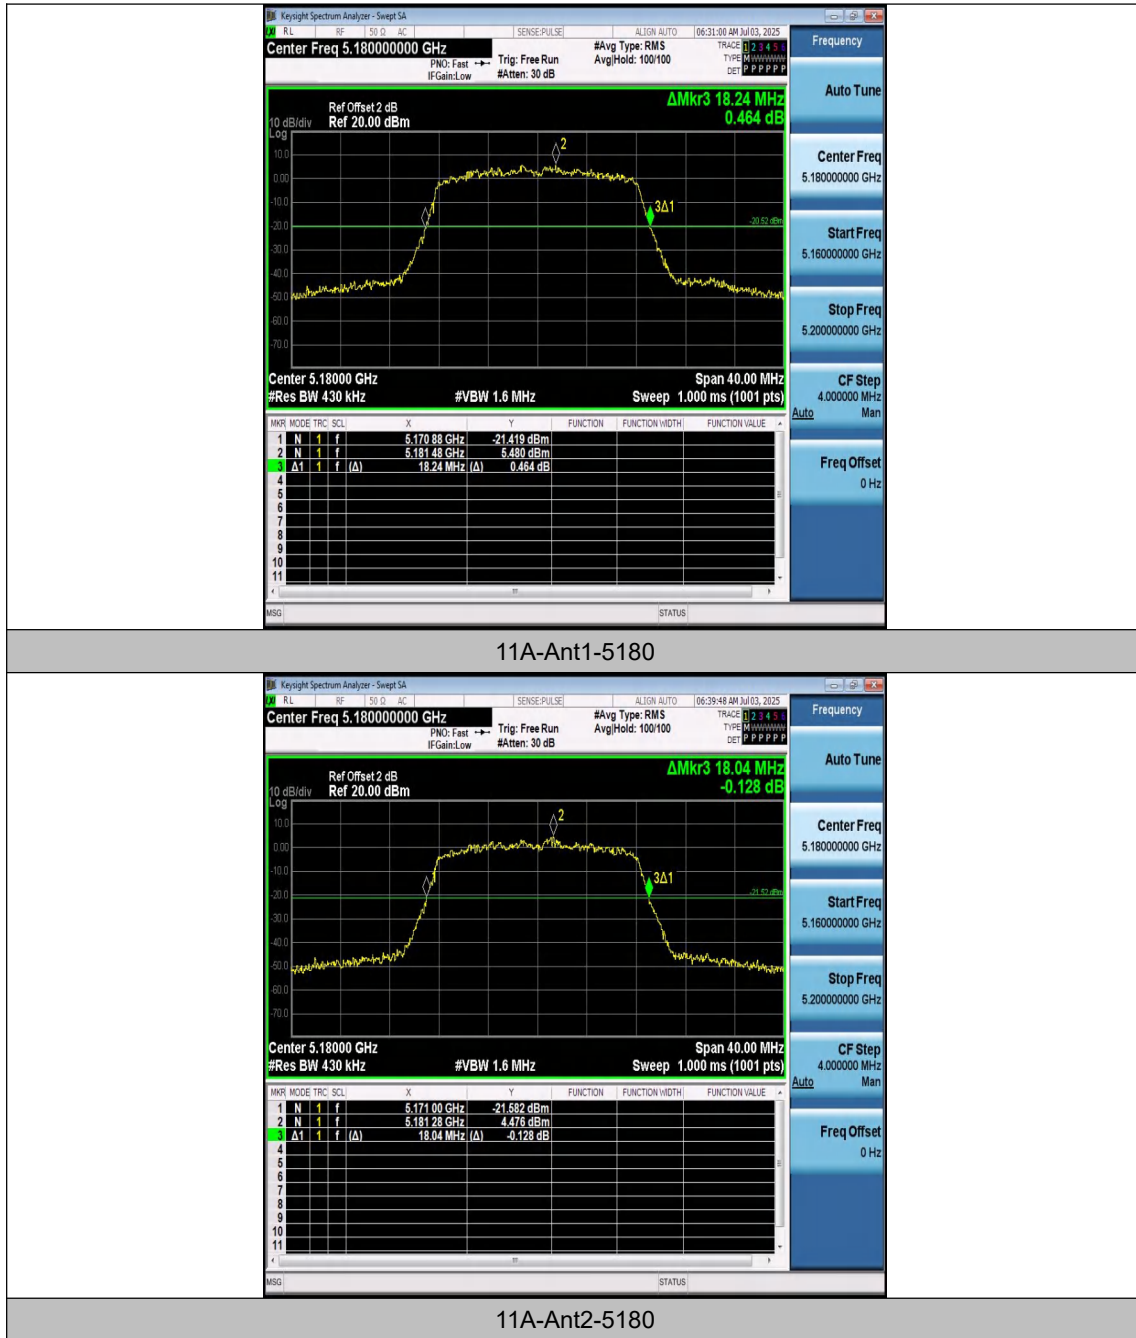

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

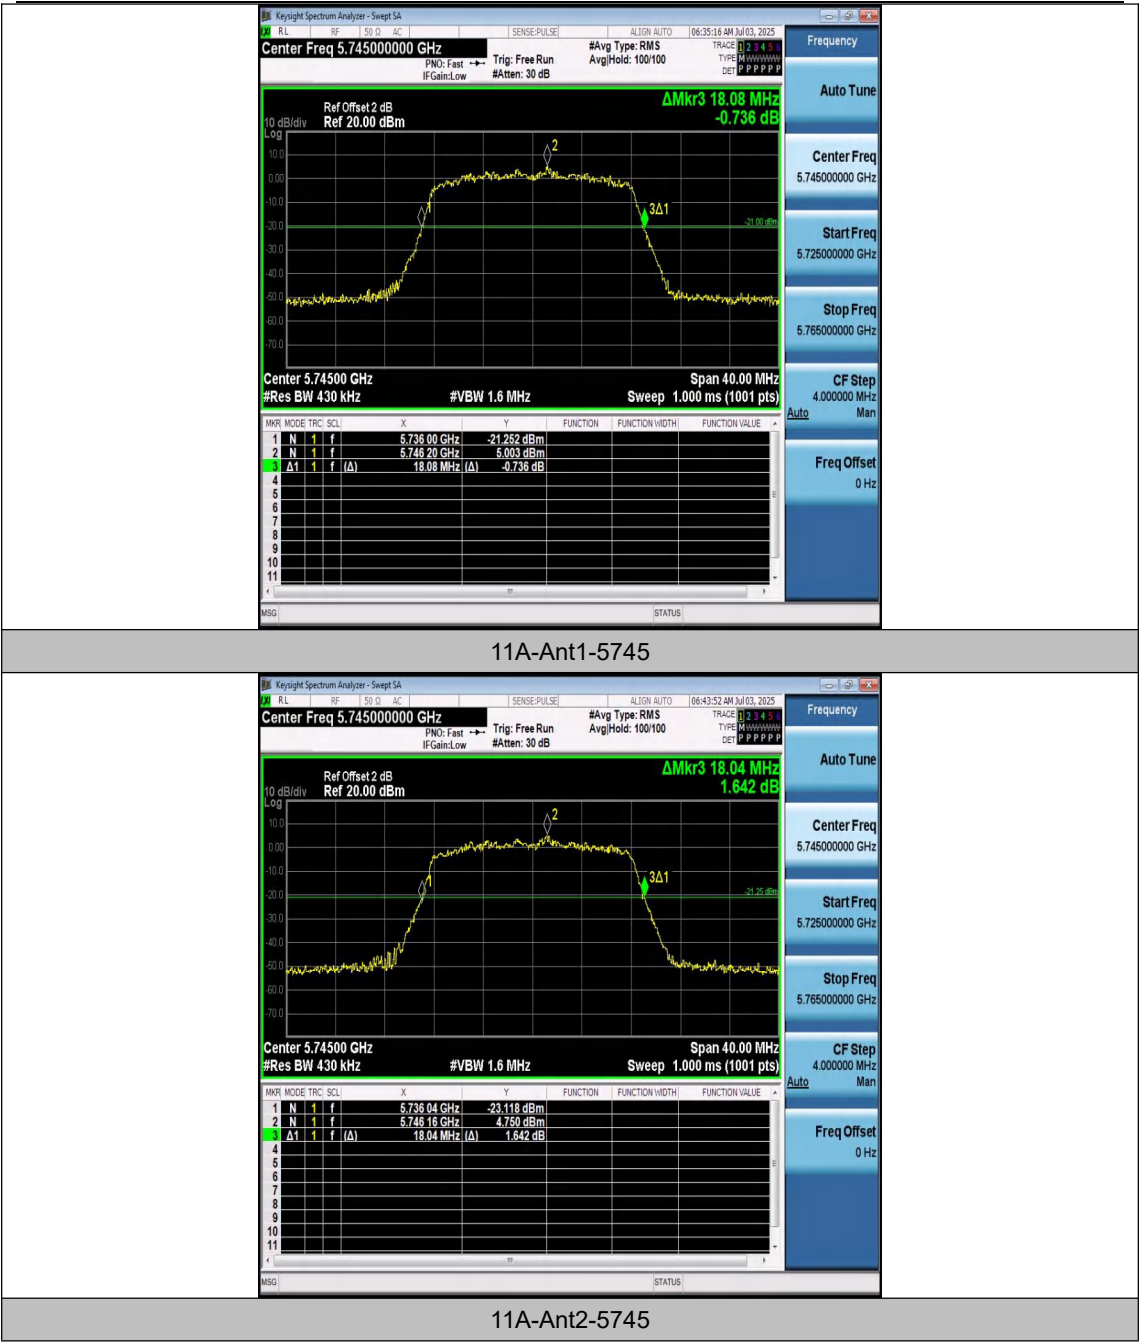


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

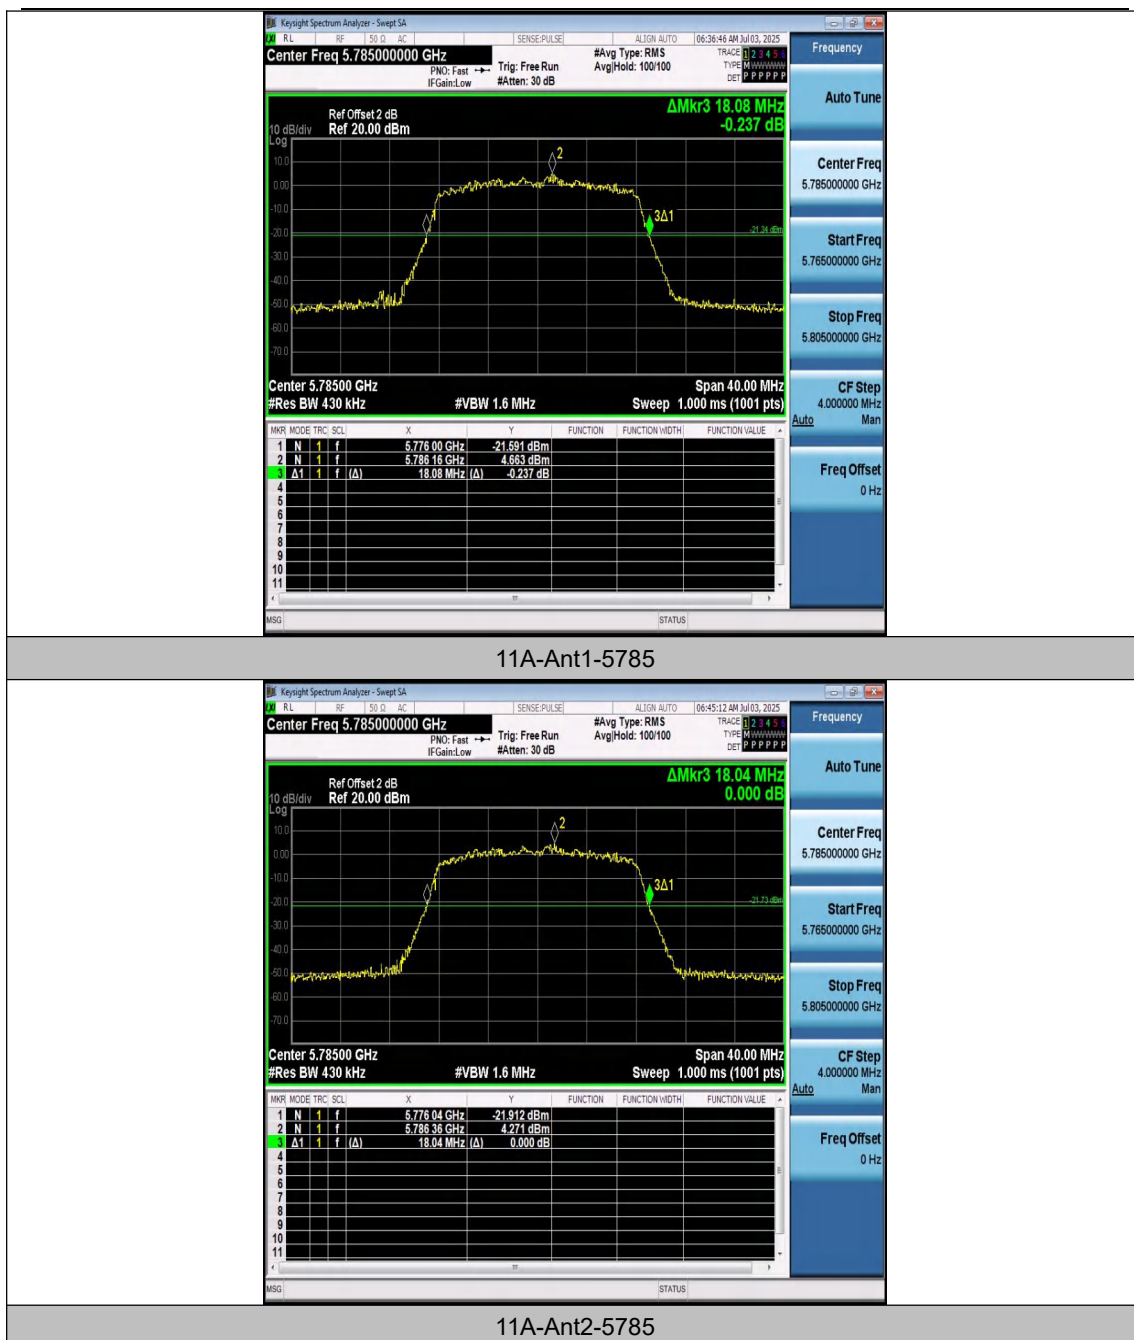


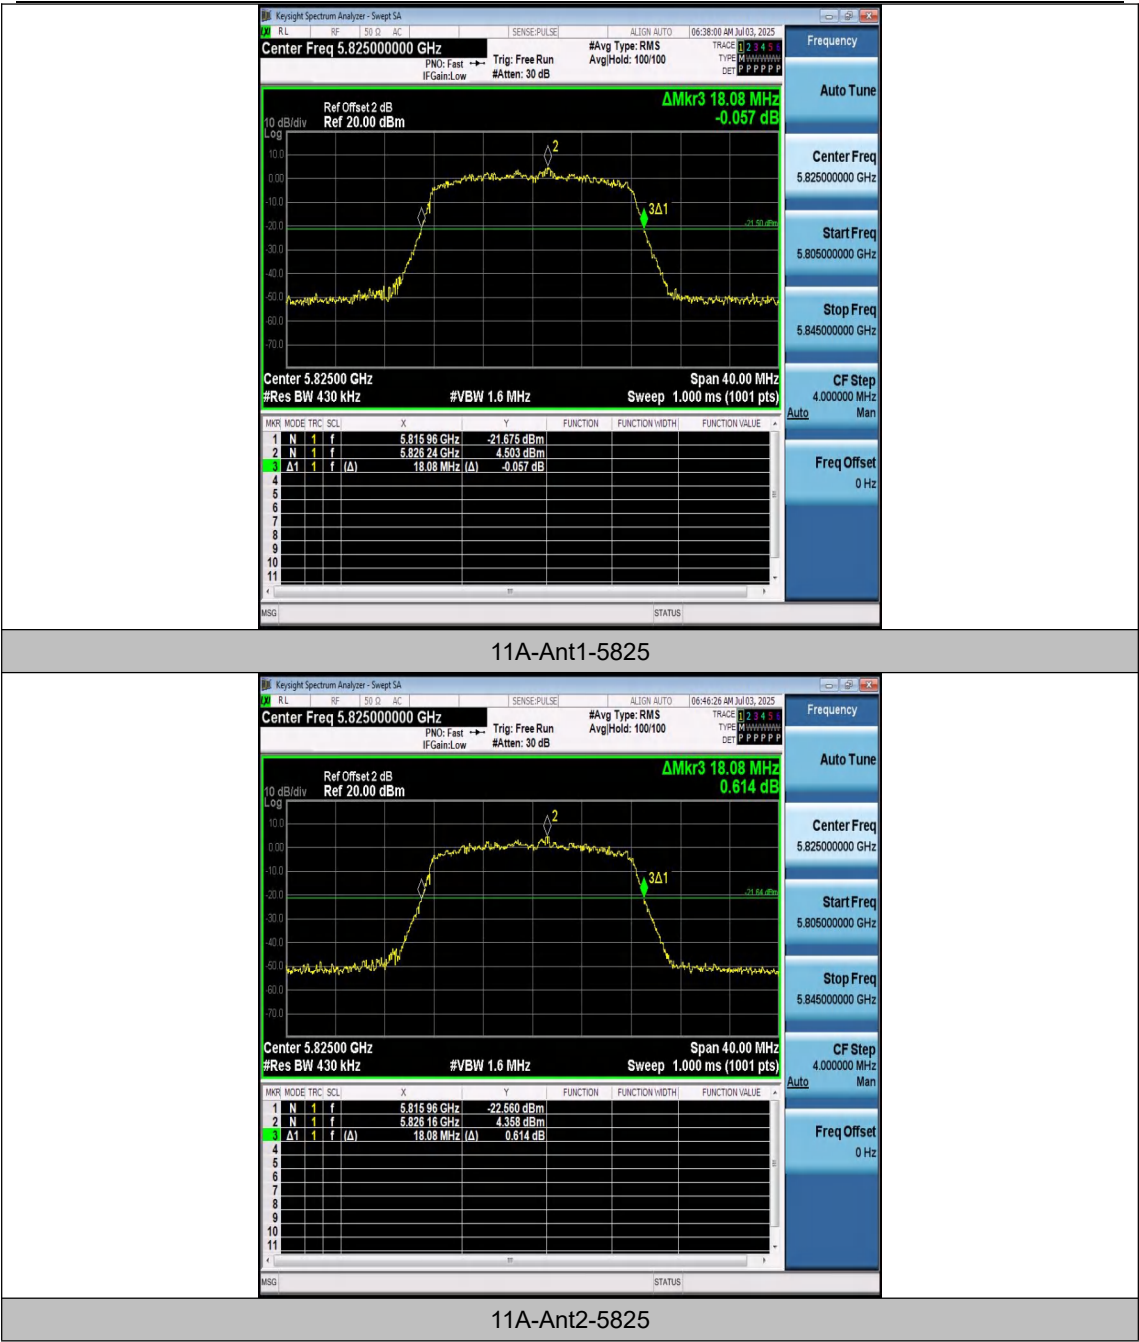

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

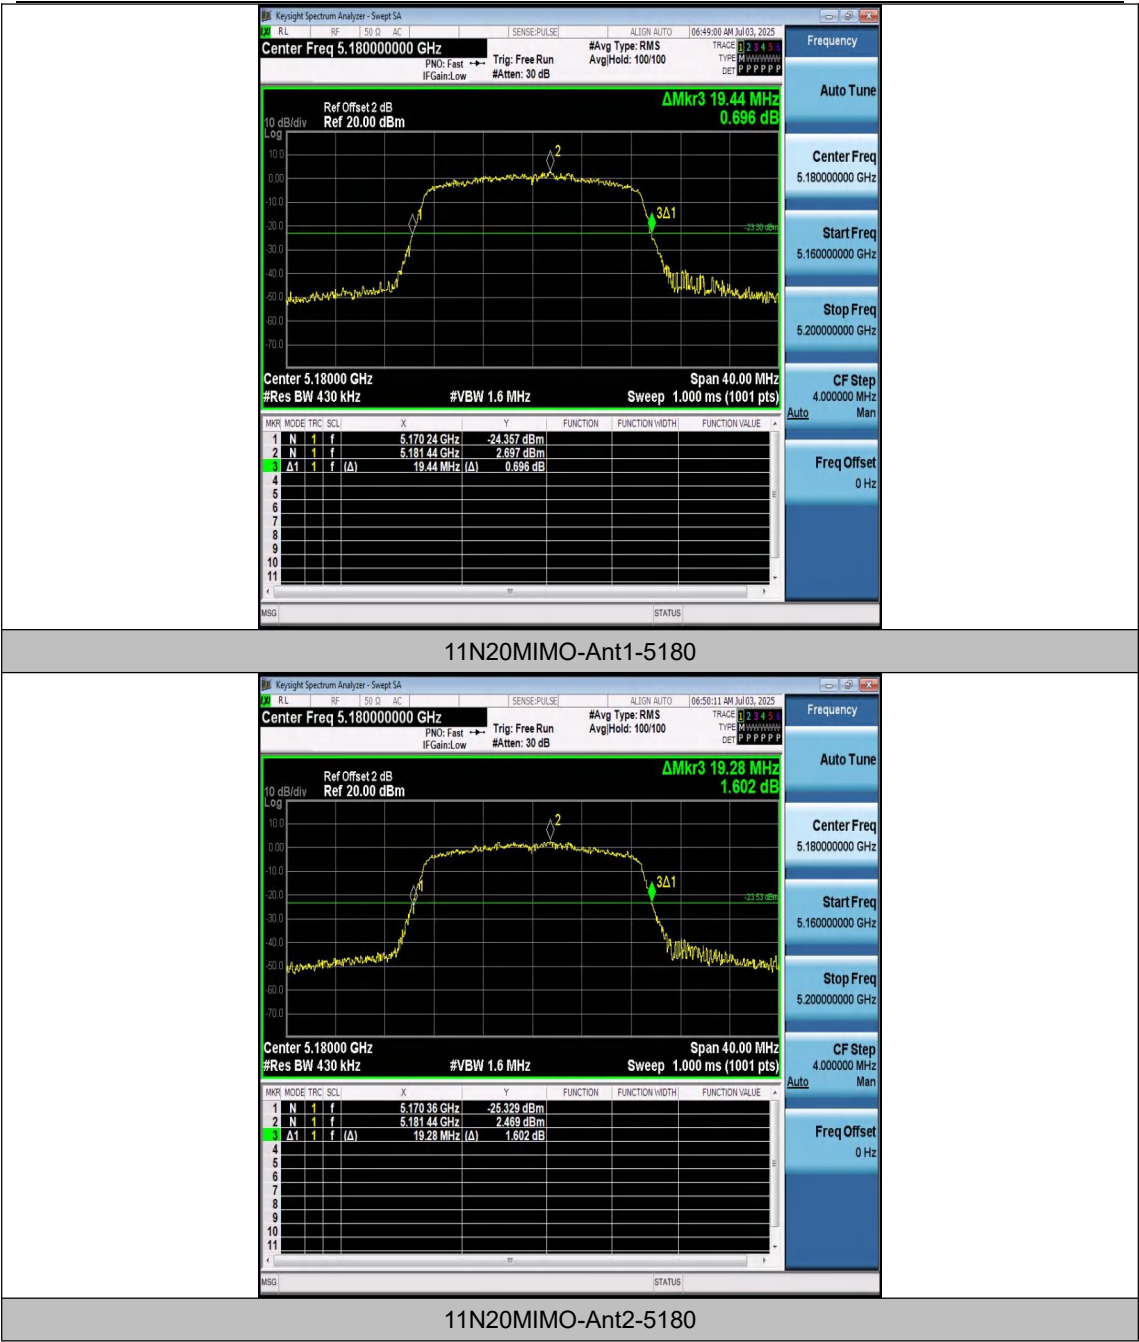

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

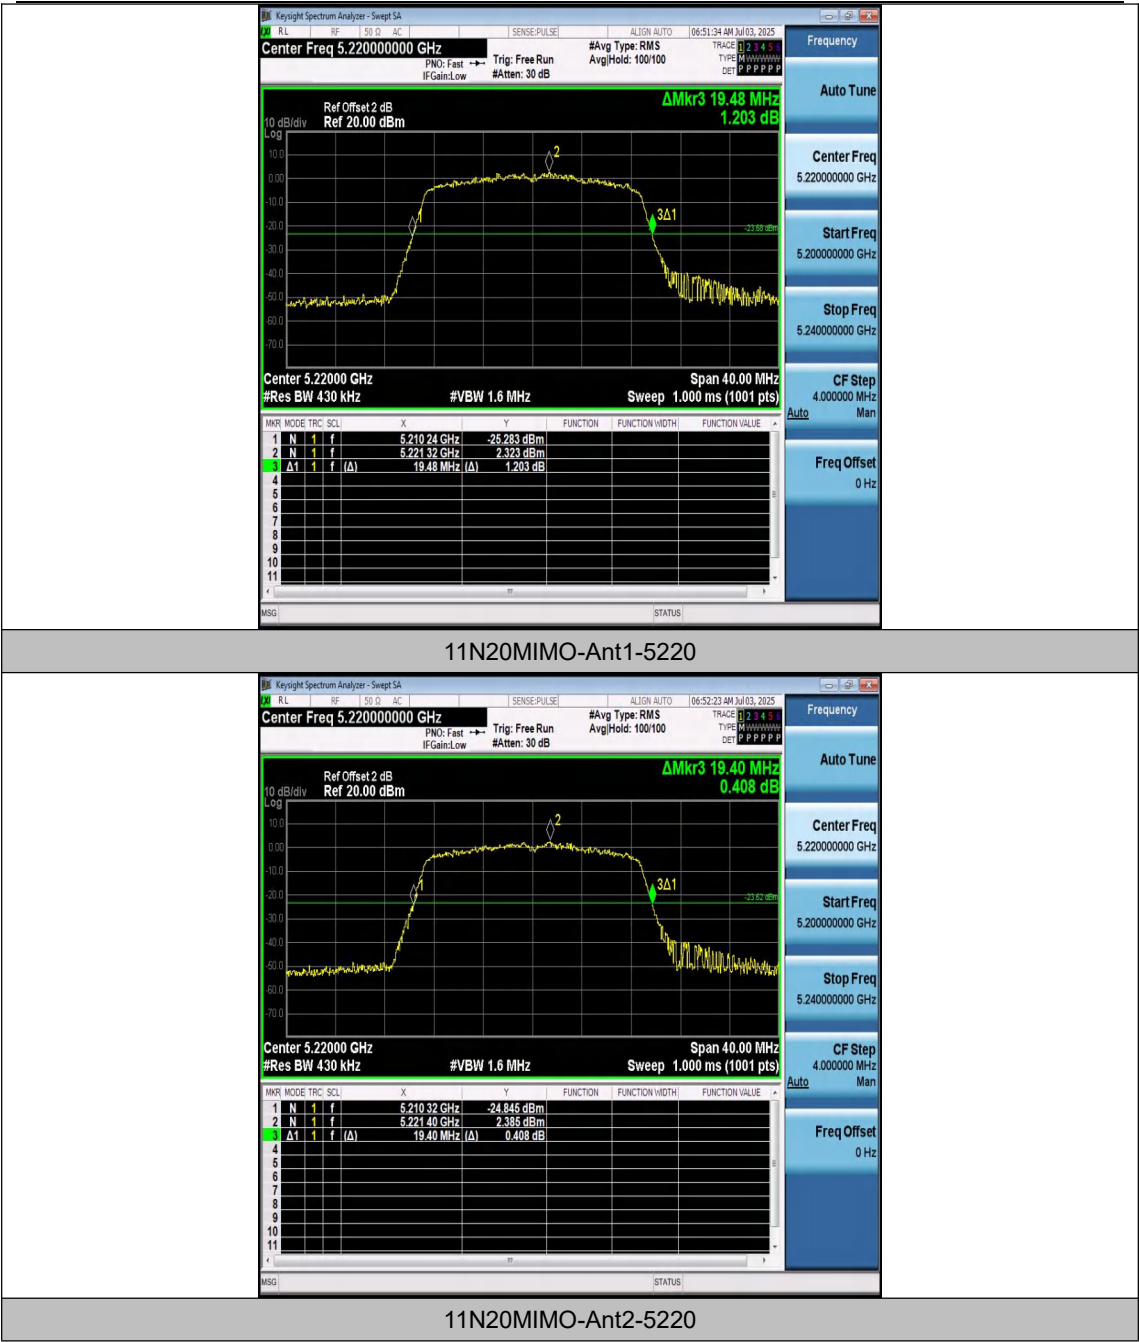



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com







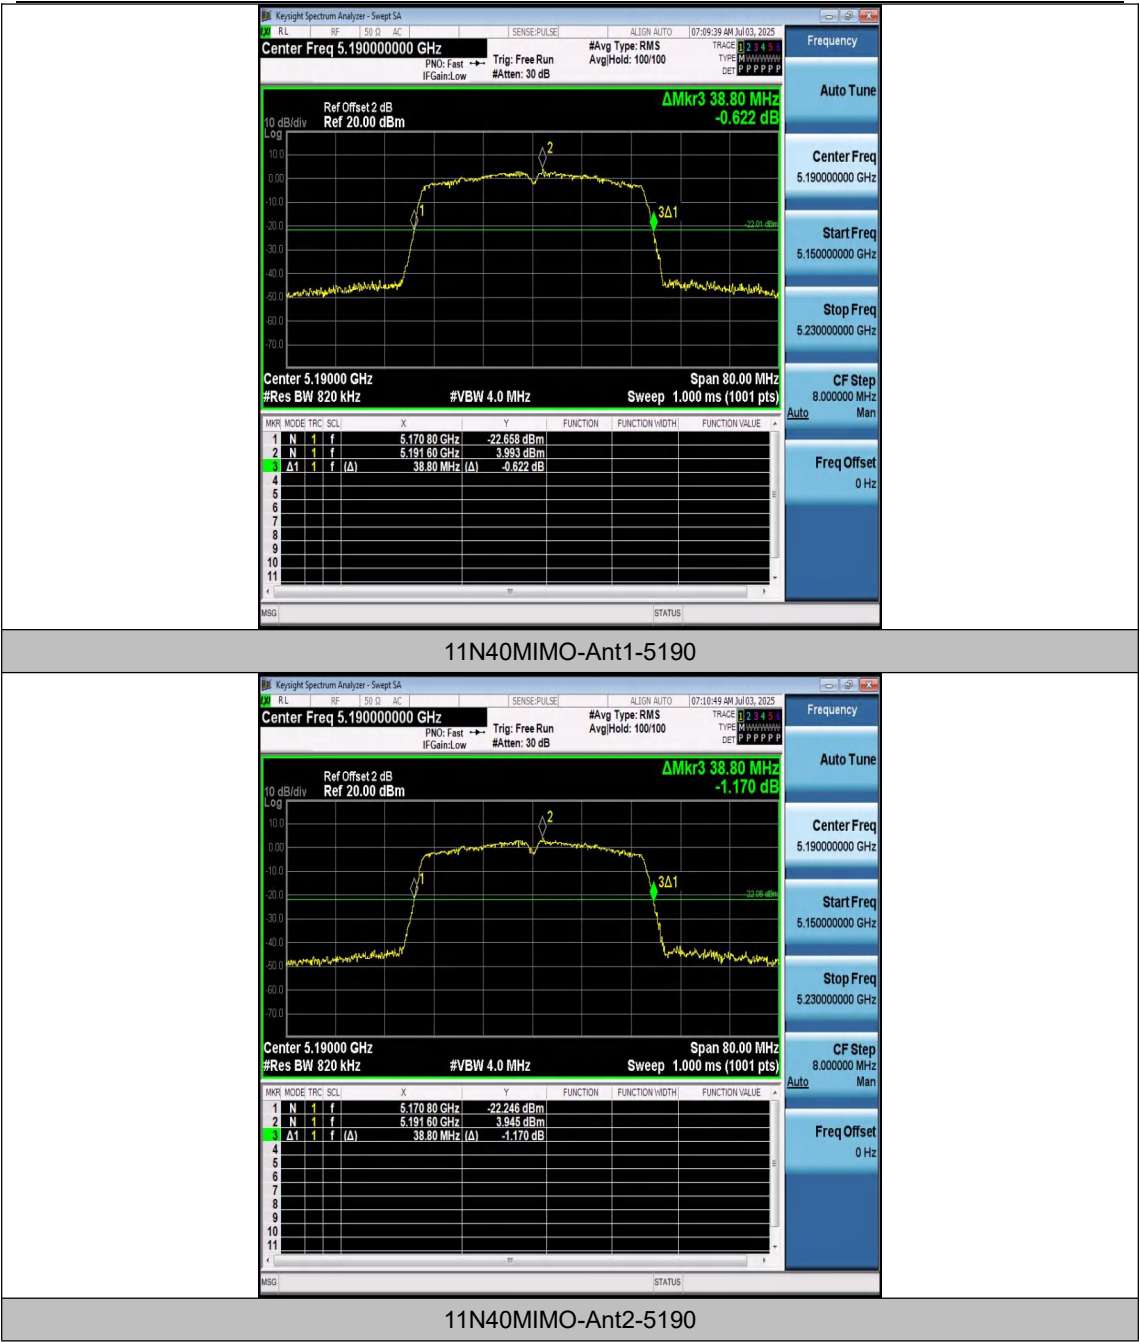

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

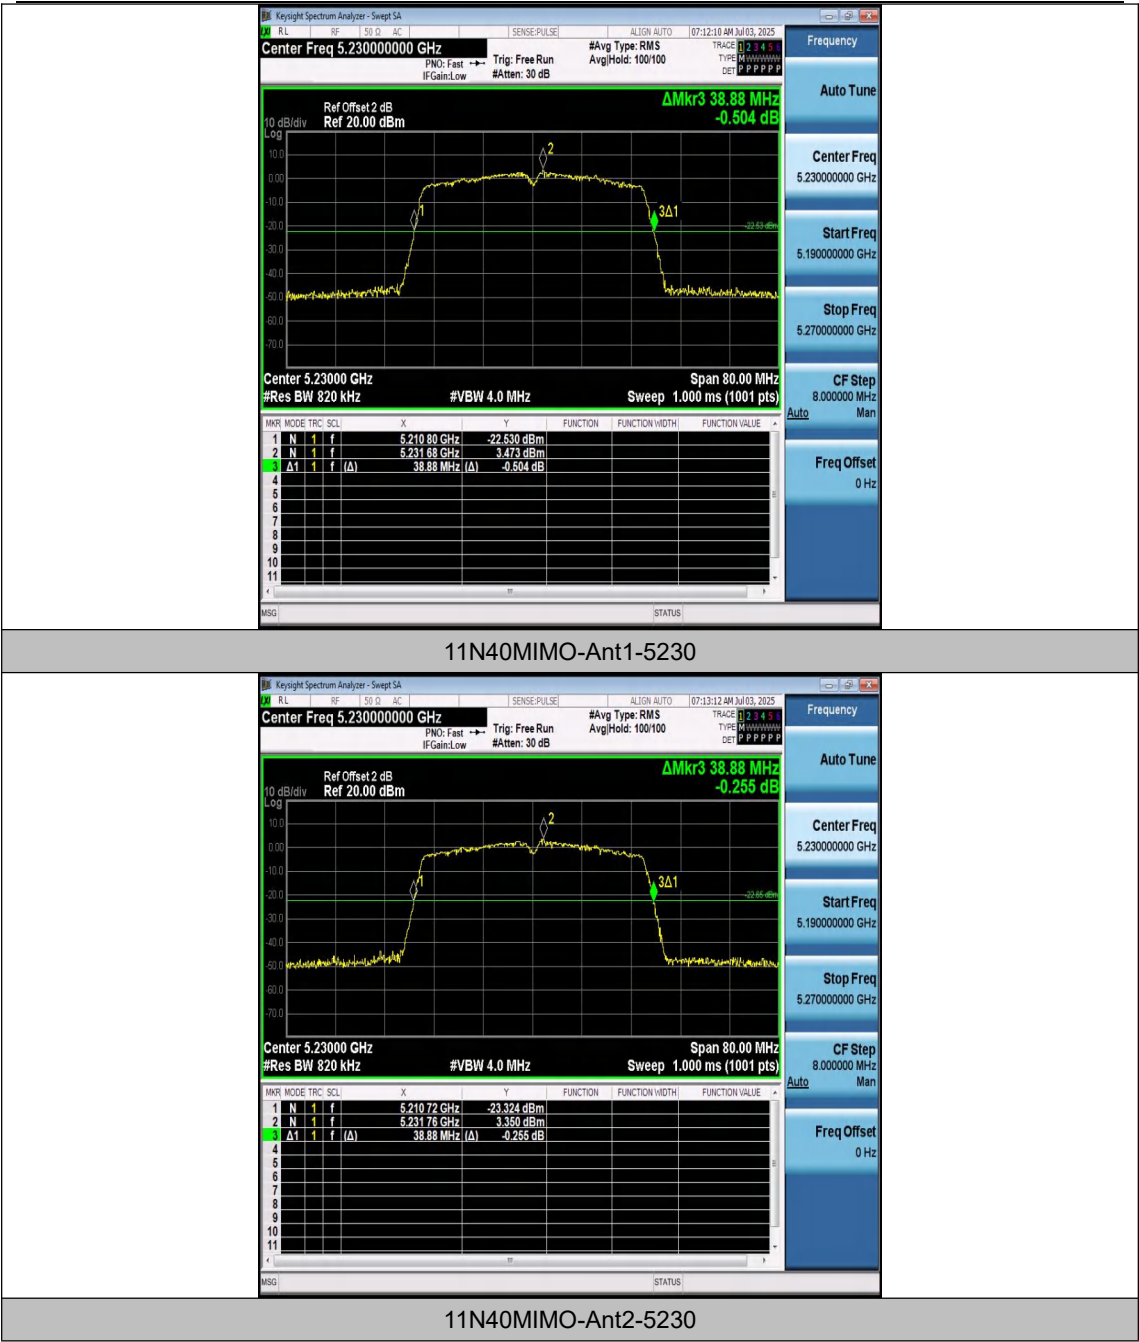


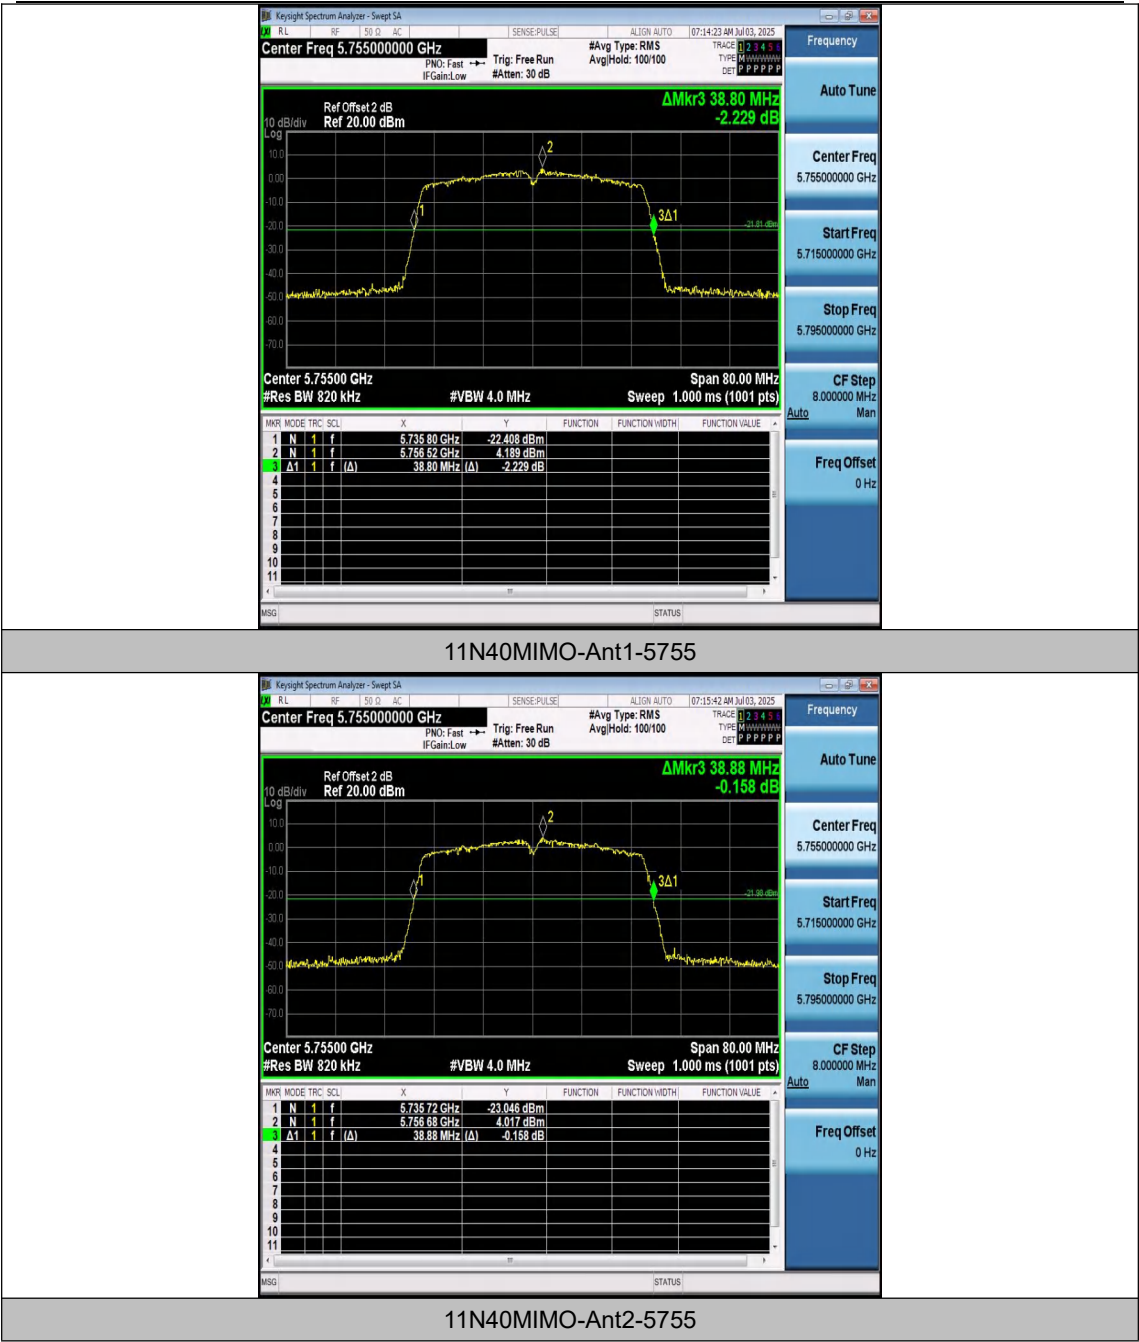

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

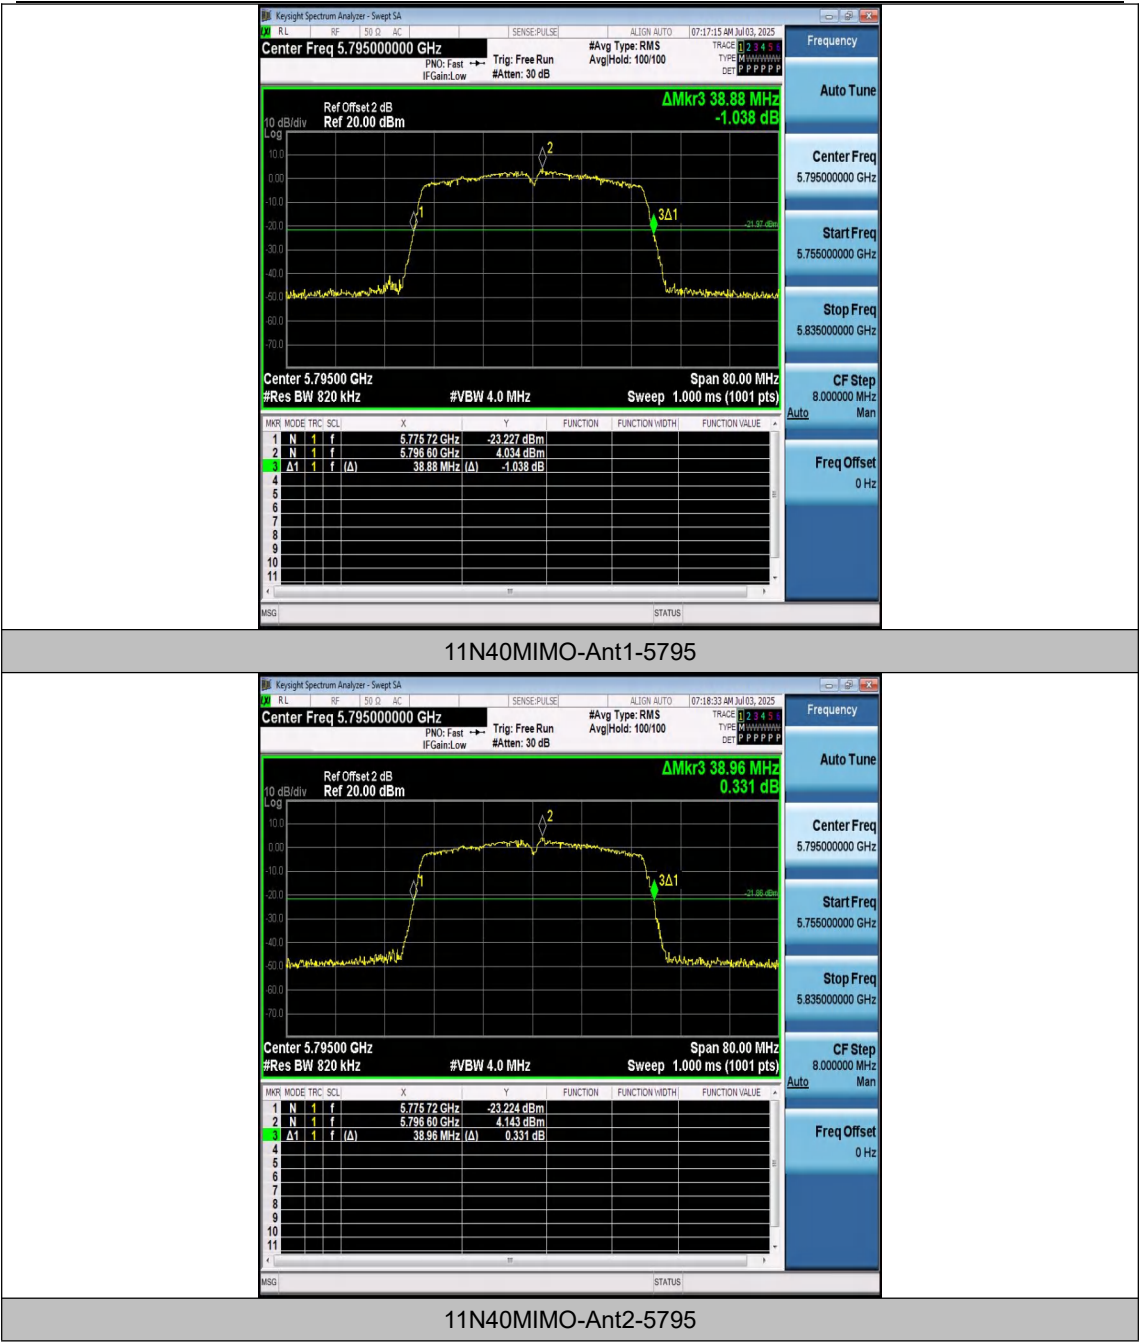



Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



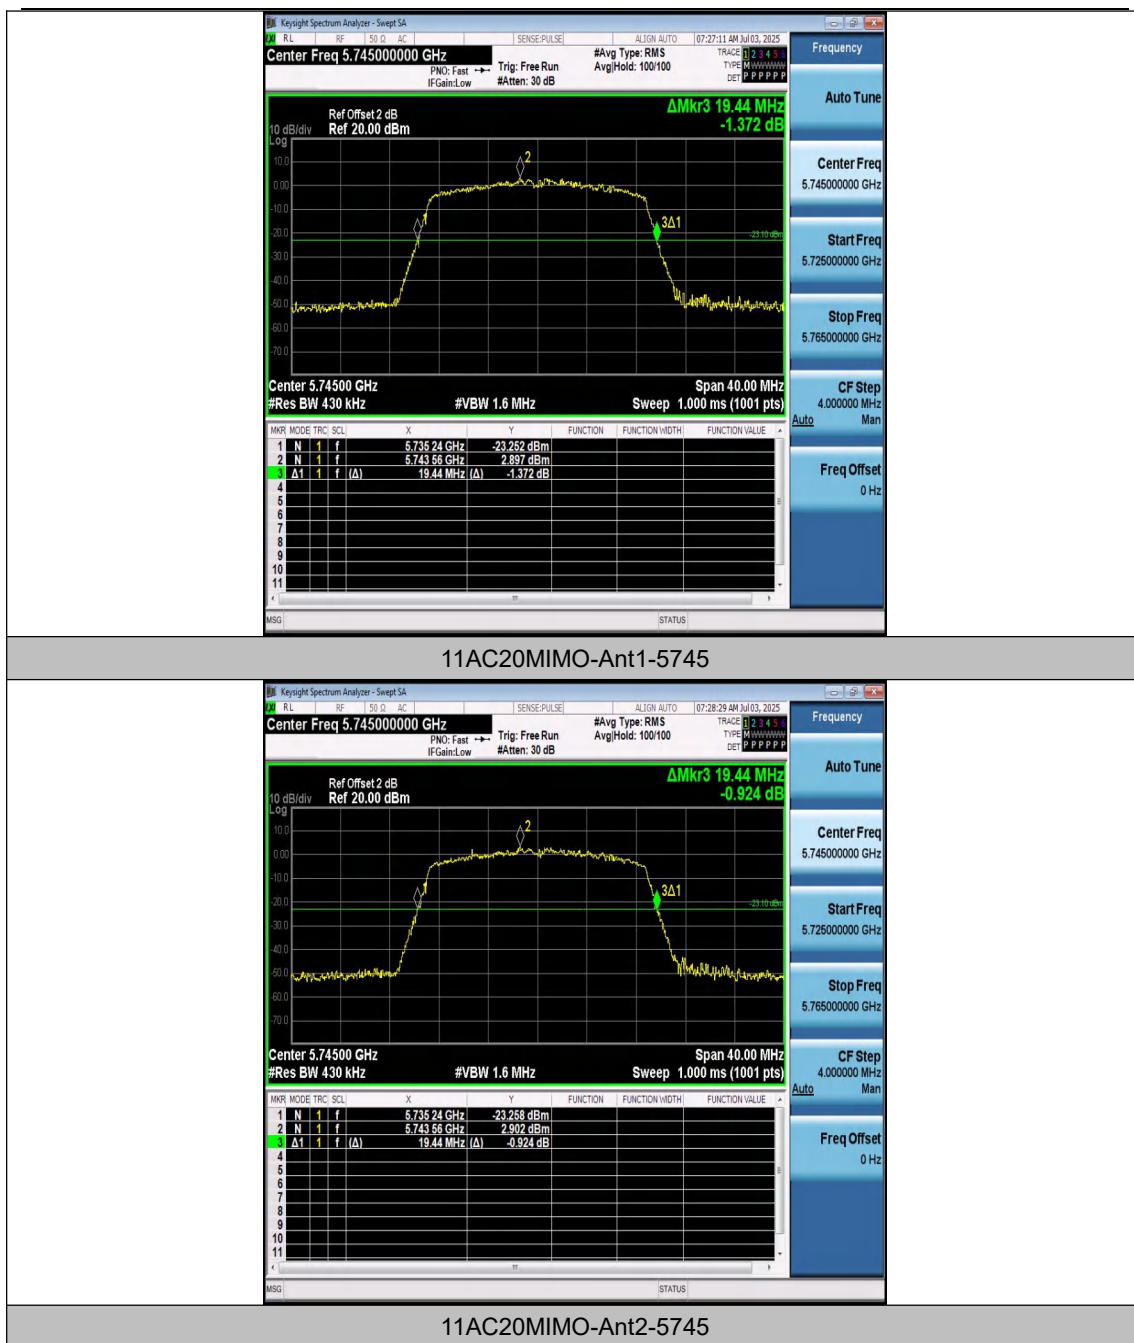




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




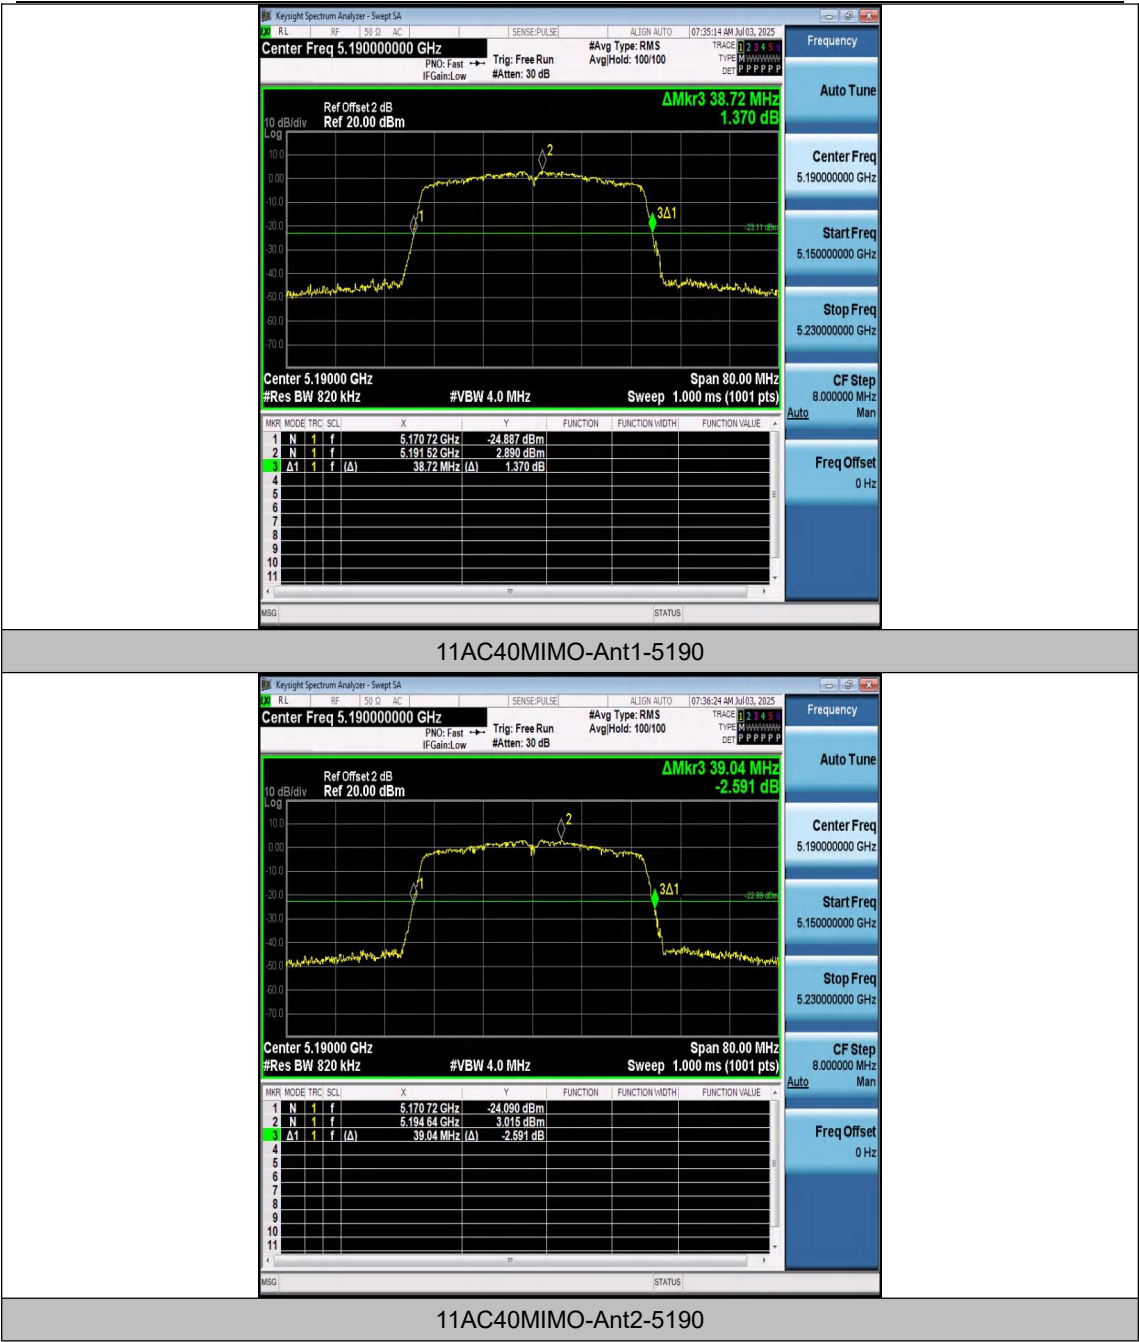

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

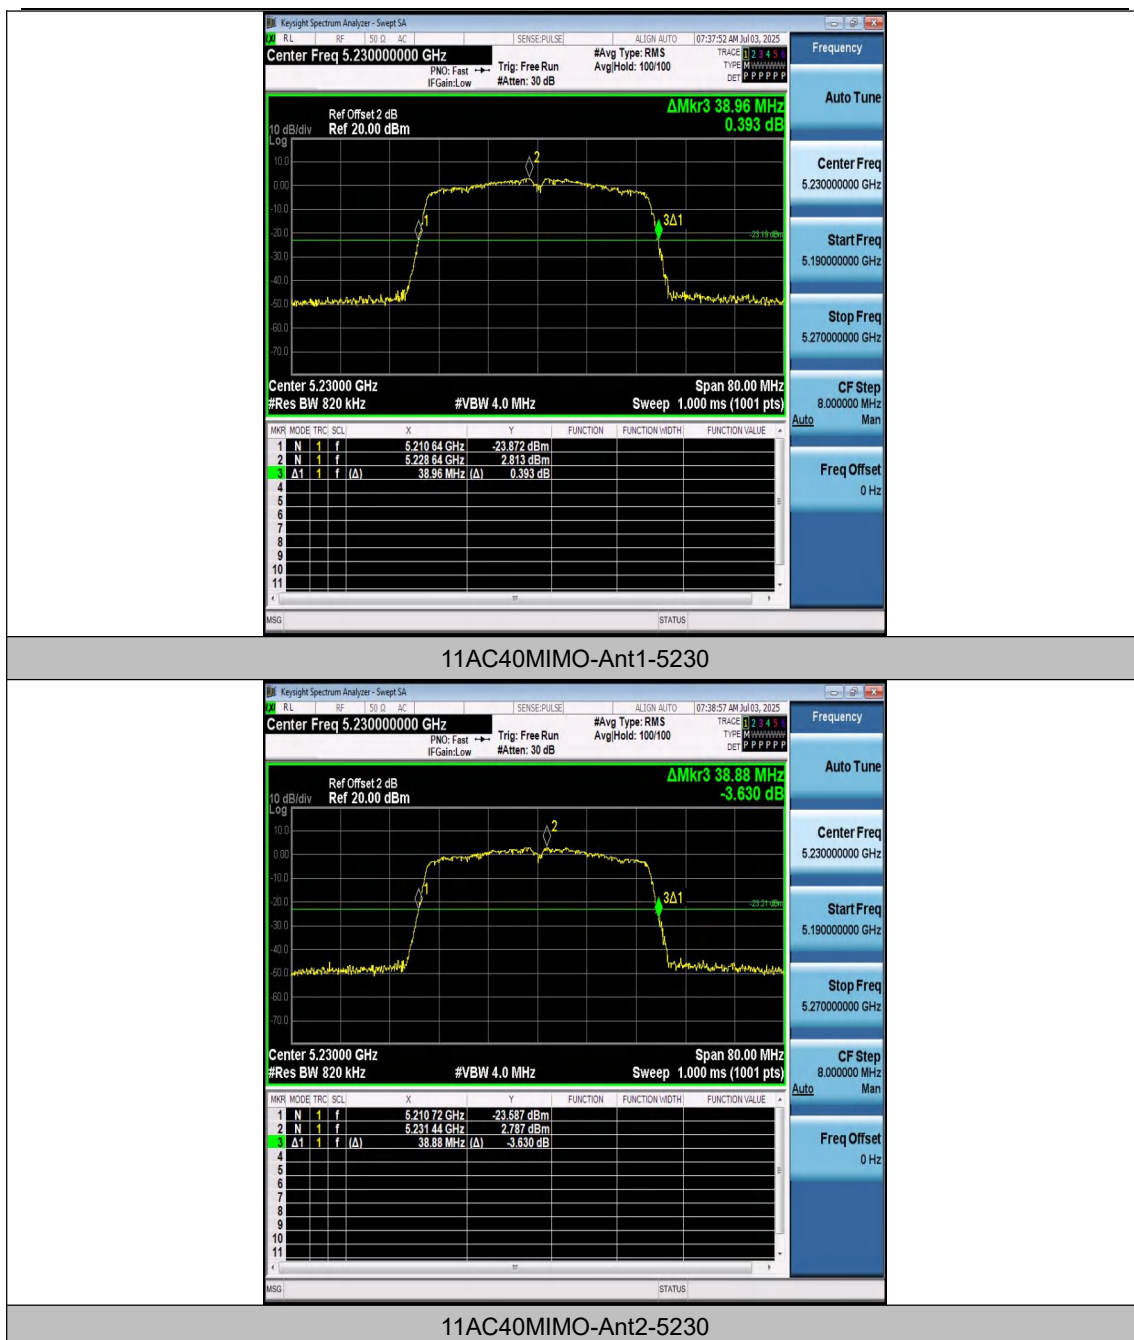

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

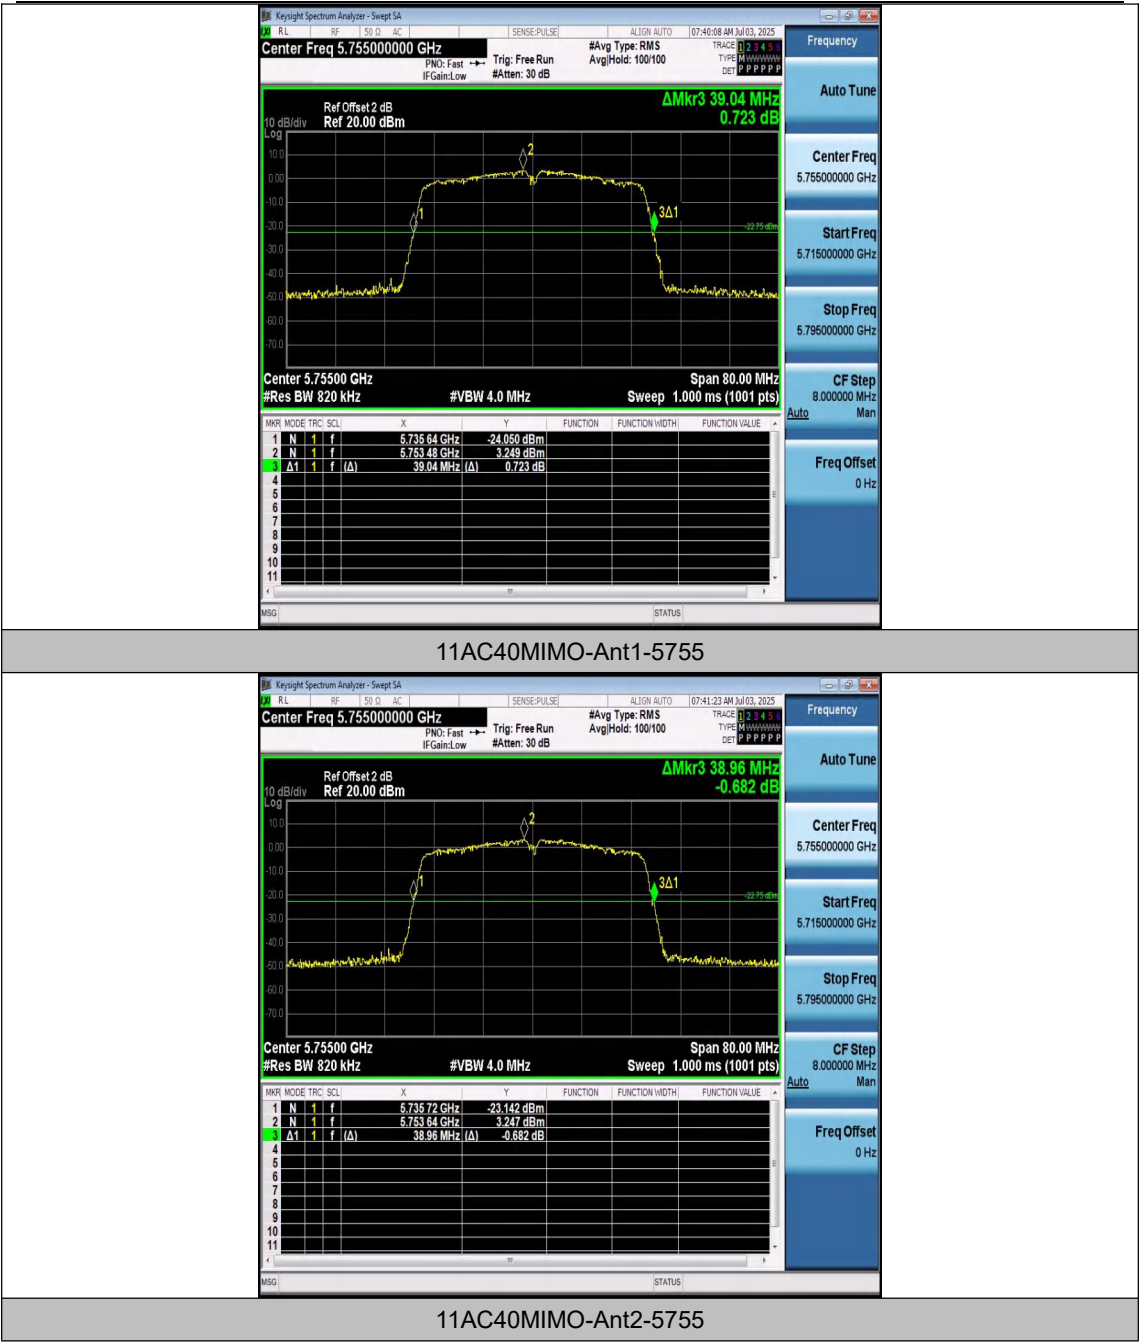



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



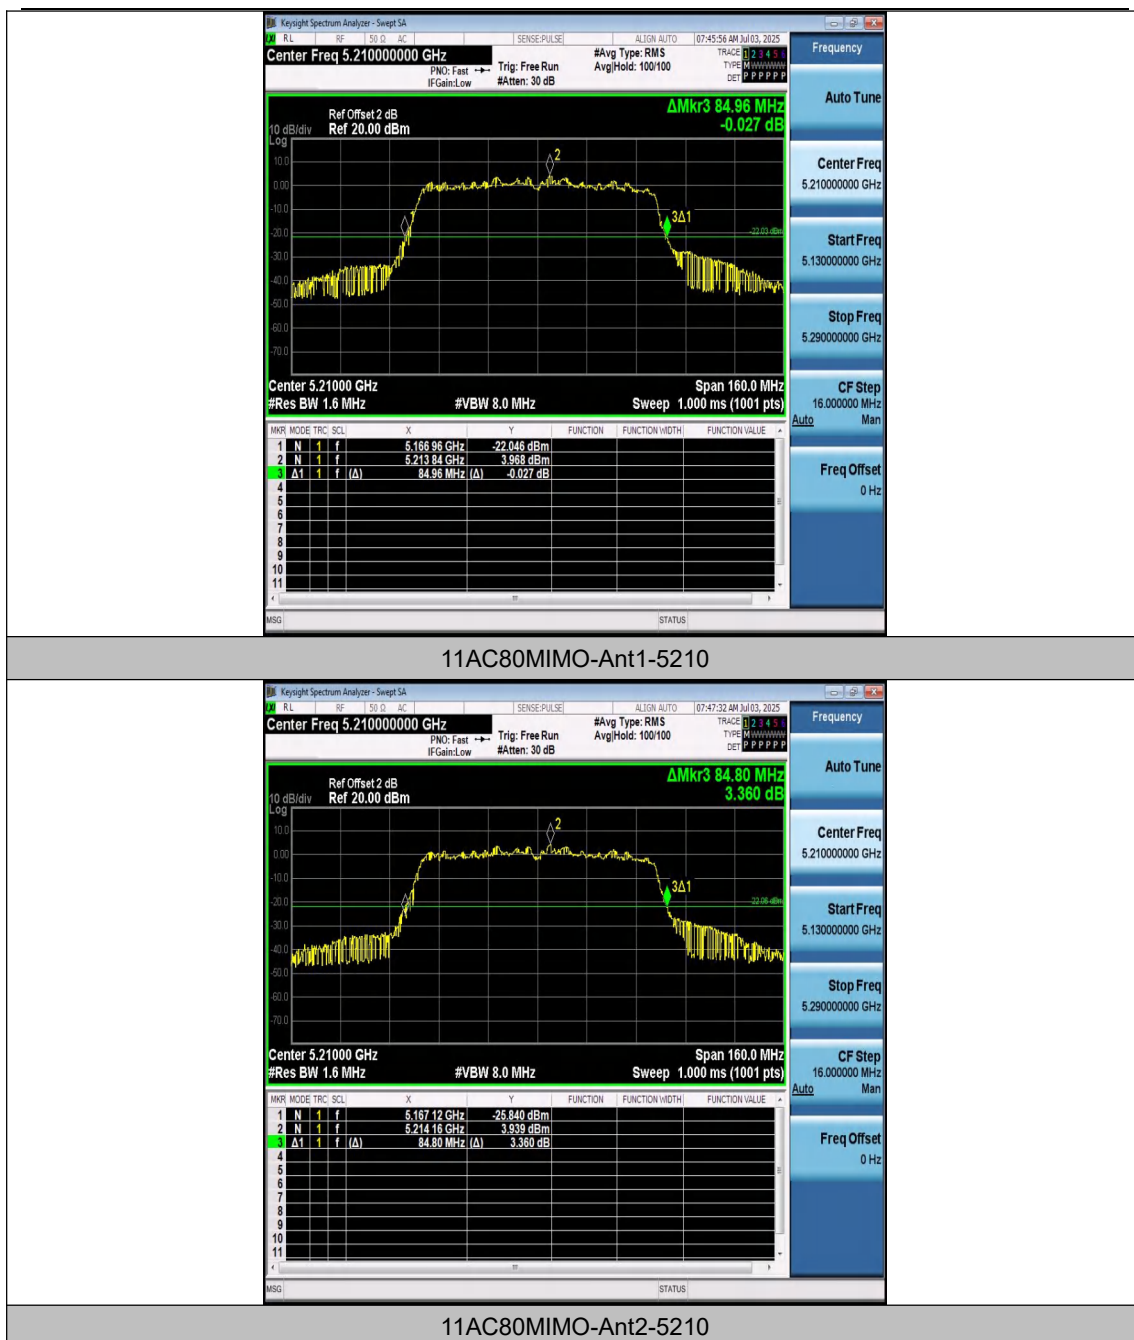

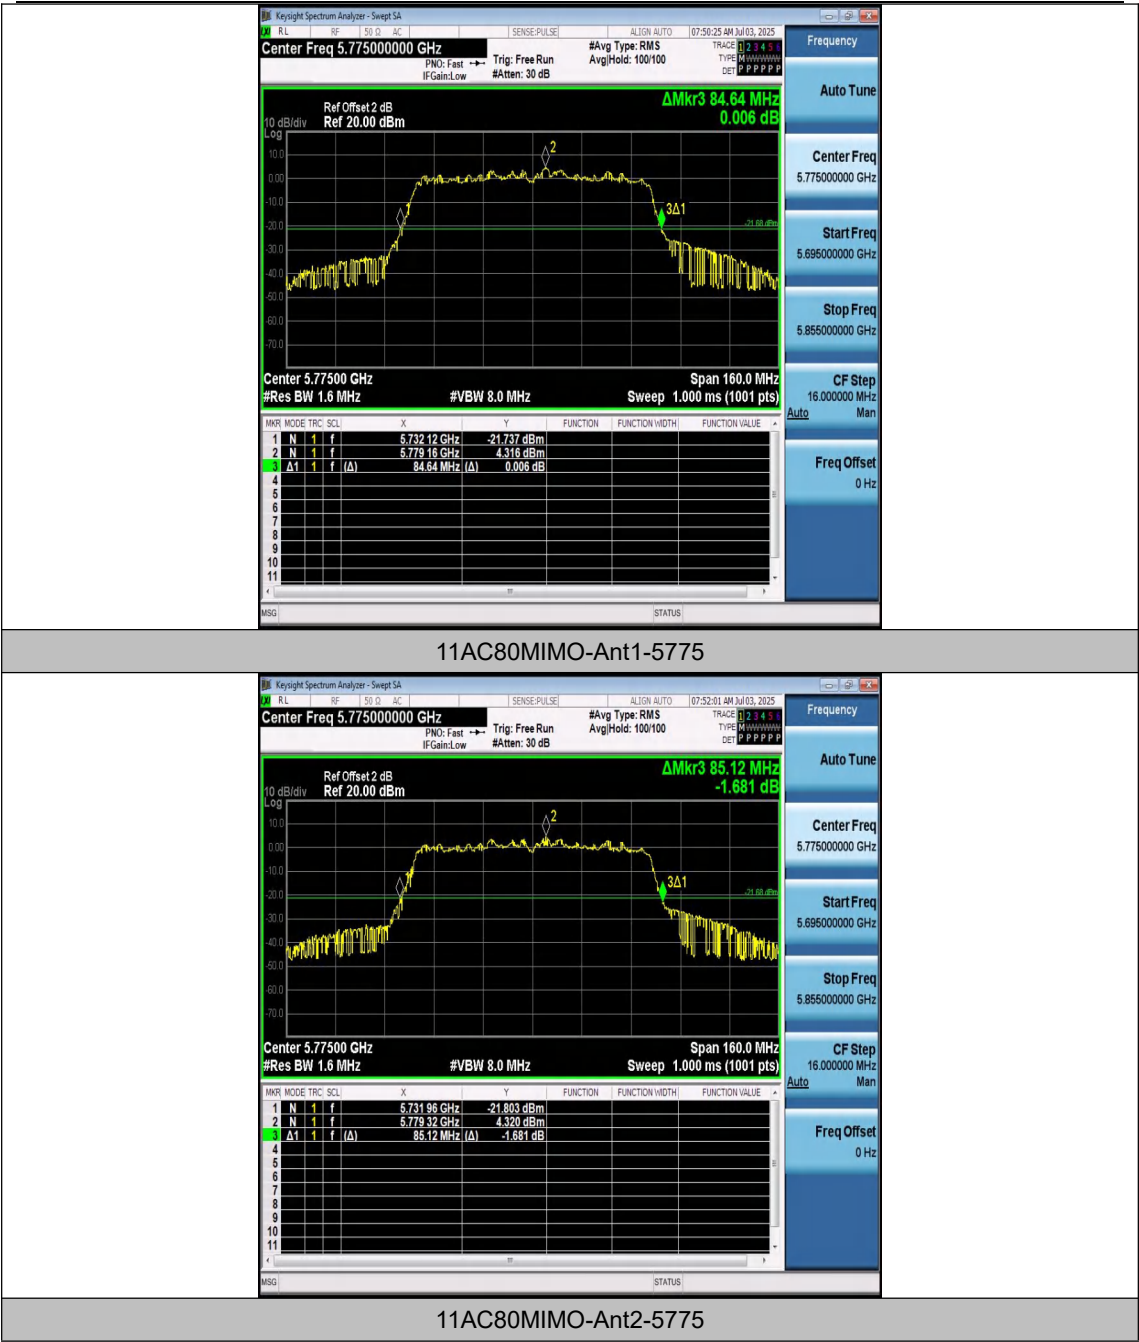

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.194	5171.9341	5188.1281	---	---
11A	Ant2	5180	16.118	5171.9684	5188.0864	---	---
11A	Ant1	5220	16.170	5211.9406	5228.1106	---	---
11A	Ant2	5220	16.204	5211.9182	5228.1222	---	---
11A	Ant1	5240	16.175	5231.9156	5248.0906	---	---
11A	Ant2	5240	16.194	5231.9193	5248.1133	---	---
11A	Ant1	5745	16.184	5736.9236	5753.1076	---	---
11A	Ant2	5745	16.196	5736.9392	5753.1352	---	---
11A	Ant1	5785	16.185	5776.9350	5793.1200	---	---
11A	Ant2	5785	16.173	5776.9413	5793.1143	---	---
11A	Ant1	5825	16.198	5816.9031	5833.1011	---	---
11A	Ant2	5825	16.174	5816.9425	5833.1165	---	---
11N20MIMO	Ant1	5180	17.288	5171.3693	5188.6573	---	---
11N20MIMO	Ant2	5180	17.312	5171.3523	5188.6643	---	---
11N20MIMO	Ant1	5220	17.261	5211.3766	5228.6376	---	---
11N20MIMO	Ant2	5220	17.262	5211.3640	5228.6260	---	---
11N20MIMO	Ant1	5240	17.274	5231.3557	5248.6297	---	---
11N20MIMO	Ant2	5240	17.299	5231.3411	5248.6401	---	---
11N20MIMO	Ant1	5745	17.283	5736.3749	5753.6579	---	---
11N20MIMO	Ant2	5745	17.281	5736.3699	5753.6509	---	---
11N20MIMO	Ant1	5785	17.300	5776.3629	5793.6629	---	---
11N20MIMO	Ant2	5785	17.262	5776.3755	5793.6375	---	---
11N20MIMO	Ant1	5825	17.304	5816.3314	5833.6354	---	---
11N20MIMO	Ant2	5825	17.280	5816.3272	5833.6072	---	---
11N40MIMO	Ant1	5190	35.561	5172.2856	5207.8466	---	---
11N40MIMO	Ant2	5190	35.524	5172.3154	5207.8394	---	---
11N40MIMO	Ant1	5230	35.543	5212.2938	5247.8368	---	---
11N40MIMO	Ant2	5230	35.566	5212.3026	5247.8686	---	---
11N40MIMO	Ant1	5755	35.556	5737.3196	5772.8756	---	---
11N40MIMO	Ant2	5755	35.585	5737.2856	5772.8706	---	---
11N40MIMO	Ant1	5795	35.540	5777.2890	5812.8290	---	---
11N40MIMO	Ant2	5795	35.554	5777.2646	5812.8186	---	---
11AC20MIMO	Ant1	5180	17.361	5171.3365	5188.6975	---	---
11AC20MIMO	Ant2	5180	17.359	5171.3239	5188.6829	---	---
11AC20MIMO	Ant1	5220	17.355	5211.3217	5228.6767	---	---
11AC20MIMO	Ant2	5220	17.367	5211.3220	5228.6890	---	---
11AC20MIMO	Ant1	5240	17.390	5231.3066	5248.6966	---	---


11AC20MIMO	Ant2	5240	17.316	5231.3557	5248.6717	---	---
11AC20MIMO	Ant1	5745	17.354	5736.3495	5753.7035	---	---
11AC20MIMO	Ant2	5745	17.341	5736.3526	5753.6936	---	---
11AC20MIMO	Ant1	5785	17.332	5776.3500	5793.6820	---	---
11AC20MIMO	Ant2	5785	17.349	5776.3435	5793.6925	---	---
11AC20MIMO	Ant1	5825	17.342	5816.3262	5833.6682	---	---
11AC20MIMO	Ant2	5825	17.363	5816.3299	5833.6929	---	---
11AC40MIMO	Ant1	5190	35.460	5172.3443	5207.8043	---	---
11AC40MIMO	Ant2	5190	35.449	5172.3488	5207.7978	---	---
11AC40MIMO	Ant1	5230	35.480	5212.3216	5247.8016	---	---
11AC40MIMO	Ant2	5230	35.475	5212.3187	5247.7937	---	---
11AC40MIMO	Ant1	5755	35.452	5737.3485	5772.8005	---	---
11AC40MIMO	Ant2	5755	35.437	5737.3561	5772.7931	---	---
11AC40MIMO	Ant1	5795	35.445	5777.2961	5812.7411	---	---
11AC40MIMO	Ant2	5795	35.460	5777.3032	5812.7632	---	---
11AC80MIMO	Ant1	5210	75.855	5172.0430	5247.8980	---	---
11AC80MIMO	Ant2	5210	76.002	5171.9227	5247.9247	---	---
11AC80MIMO	Ant1	5775	76.051	5737.0224	5813.0734	---	---
11AC80MIMO	Ant2	5775	76.020	5737.0388	5813.0588	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

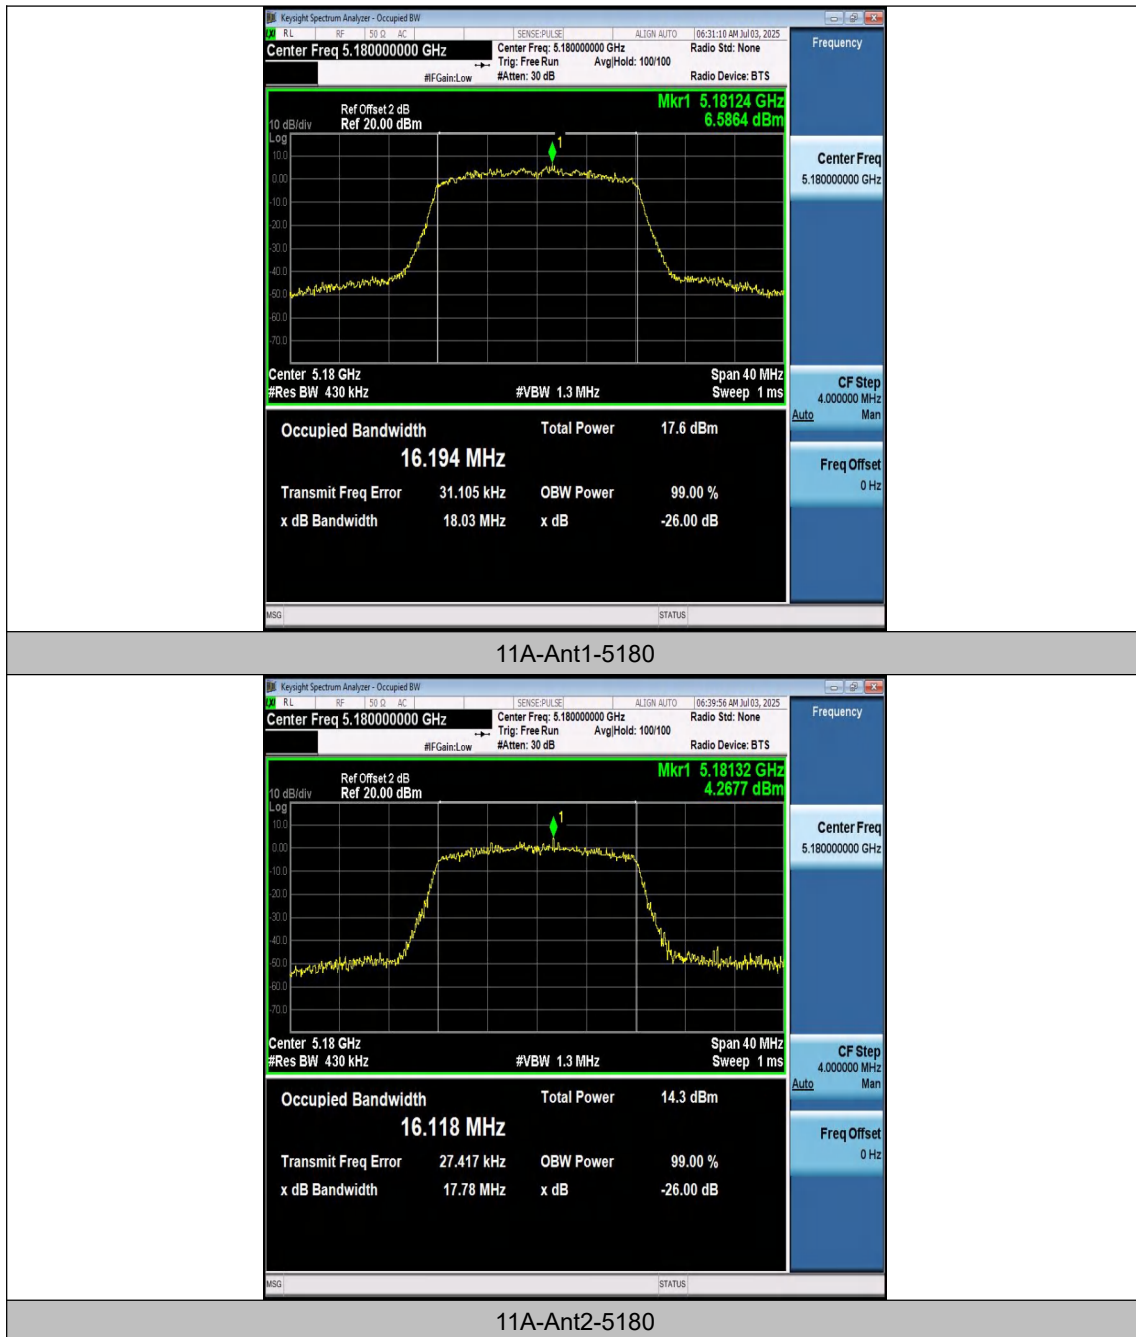

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

