

11A	Ant1	Low	5745	5700~5720	-46.68	≤10.35	PASS
11A	Ant1	Low	5745	5650~5700	-48.45	≤-26.79	PASS
11A	Ant1	Low	5745	5760~5650	-46.75	≤-27	PASS
11A	Ant2	Low	5745	5720~5725	-45.67	≤17.39	PASS
11A	Ant2	Low	5745	5700~5720	-47.79	≤10.15	PASS
11A	Ant2	Low	5745	5650~5700	-48.16	≤-26.70	PASS
11A	Ant2	Low	5745	5760~5650	-47.03	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-48.62	≤15.73	PASS
11A	Ant1	High	5825	5855~5875	-48.23	≤10.02	PASS
11A	Ant1	High	5825	5875~5925	-48.87	≤-26.91	PASS
11A	Ant1	High	5825	5925~5935	-47.86	≤-27	PASS
11A	Ant2	High	5825	5850~5855	-47.41	≤15.73	PASS
11A	Ant2	High	5825	5855~5875	-47.14	≤11.72	PASS
11A	Ant2	High	5825	5875~5925	-48.71	≤-26.01	PASS
11A	Ant2	High	5825	5925~5935	-47.22	≤-27	PASS
11N20MI MO	Ant1	Low	5745	5720~5725	-46.33	≤16.87	PASS
11N20MI MO	Ant1	Low	5745	5700~5720	-46.49	≤10.09	PASS
11N20MI MO	Ant1	Low	5745	5650~5700	-48.22	≤-25.85	PASS
11N20MI MO	Ant1	Low	5745	5760~5650	-47.95	≤-27	PASS
11N20MI MO	Ant2	Low	5745	5720~5725	-46.15	≤16.60	PASS
11N20MI MO	Ant2	Low	5745	5700~5720	-46.05	≤10.96	PASS
11N20MI MO	Ant2	Low	5745	5650~5700	-48.15	≤-26.27	PASS
11N20MI MO	Ant2	Low	5745	5760~5650	-47.65	≤-27	PASS
11N20MI MO	Ant1	High	5825	5850~5855	-46.53	≤16.65	PASS
11N20MI MO	Ant1	High	5825	5855~5875	-46.51	≤10.44	PASS
11N20MI MO	Ant1	High	5825	5875~5925	-48.64	≤-26.61	PASS
11N20MI MO	Ant1	High	5825	5925~5935	-48.77	≤-27	PASS
11N20MI MO	Ant2	High	5825	5850~5855	-47.32	≤16.96	PASS
11N20MI MO	Ant2	High	5825	5855~5875	-47.91	≤10.47	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11N20MI MO	Ant2	High	5825	5875~5925	-49.21	≤-26.81	PASS
11N20MI MO	Ant2	High	5825	5925~5935	-47.94	≤-27	PASS
11N40MI MO	Ant1	Low	5755	5720~5725	-47.21	≤15.74	PASS
11N40MI MO	Ant1	Low	5755	5700~5720	-47.04	≤10.21	PASS
11N40MI MO	Ant1	Low	5755	5650~5700	-49.29	≤-26.70	PASS
11N40MI MO	Ant1	Low	5755	5780~5650	-46.88	≤-27	PASS
11N40MI MO	Ant2	Low	5755	5720~5725	-45.35	≤17.28	PASS
11N40MI MO	Ant2	Low	5755	5700~5720	-46.78	≤10.48	PASS
11N40MI MO	Ant2	Low	5755	5650~5700	-48.17	≤-26.60	PASS
11N40MI MO	Ant2	Low	5755	5780~5650	-48.31	≤-27	PASS
11N40MI MO	Ant1	High	5795	5850~5855	-48.38	≤15.66	PASS
11N40MI MO	Ant1	High	5795	5855~5875	-47.47	≤10.80	PASS
11N40MI MO	Ant1	High	5795	5875~5925	-48.3	≤-26.59	PASS
11N40MI MO	Ant1	High	5795	5925~5935	-47.82	≤-27	PASS
11N40MI MO	Ant2	High	5795	5850~5855	-48.84	≤16.03	PASS
11N40MI MO	Ant2	High	5795	5855~5875	-46.8	≤10.43	PASS
11N40MI MO	Ant2	High	5795	5875~5925	-48.82	≤-26.46	PASS
11N40MI MO	Ant2	High	5795	5925~5935	-48.46	≤-27	PASS
11AC20M IMO	Ant1	Low	5745	5720~5725	-46.42	≤16.08	PASS
11AC20M IMO	Ant1	Low	5745	5700~5720	-45.71	≤10.67	PASS
11AC20M IMO	Ant1	Low	5745	5650~5700	-48.2	≤-26.45	PASS
11AC20M	Ant1	Low	5745	5760~5650	-47.73	≤-27	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

IMO							
11AC20M IMO	Ant2	Low	5745	5720~5725	-46.49	≤15.82	PASS
11AC20M IMO	Ant2	Low	5745	5700~5720	-46.38	≤10.64	PASS
11AC20M IMO	Ant2	Low	5745	5650~5700	-46.67	≤-26.19	PASS
11AC20M IMO	Ant2	Low	5745	5760~5650	-48.01	≤-27	PASS
11AC20M IMO	Ant1	High	5825	5850~5855	-46	≤16.65	PASS
11AC20M IMO	Ant1	High	5825	5855~5875	-48.06	≤10.13	PASS
11AC20M IMO	Ant1	High	5825	5875~5925	-48.94	≤-26.51	PASS
11AC20M IMO	Ant1	High	5825	5925~5935	-47.94	≤-27	PASS
11AC20M IMO	Ant2	High	5825	5850~5855	-48.31	≤15.73	PASS
11AC20M IMO	Ant2	High	5825	5855~5875	-47.39	≤11.23	PASS
11AC20M IMO	Ant2	High	5825	5875~5925	-48.72	≤-26.71	PASS
11AC20M IMO	Ant2	High	5825	5925~5935	-48.01	≤-27	PASS
11AC40M IMO	Ant1	Low	5755	5720~5725	-47.09	≤16.04	PASS
11AC40M IMO	Ant1	Low	5755	5700~5720	-46.7	≤10.55	PASS
11AC40M IMO	Ant1	Low	5755	5650~5700	-49	≤-26.70	PASS
11AC40M IMO	Ant1	Low	5755	5780~5650	-47.37	≤-27	PASS
11AC40M IMO	Ant2	Low	5755	5720~5725	-46.17	≤15.74	PASS
11AC40M IMO	Ant2	Low	5755	5700~5720	-46.64	≤10.48	PASS
11AC40M IMO	Ant2	Low	5755	5650~5700	-47.87	≤-26.30	PASS
11AC40M IMO	Ant2	Low	5755	5780~5650	-47.72	≤-27	PASS
11AC40M IMO	Ant1	High	5795	5850~5855	-48.7	≤15.66	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC40M IMO	Ant1	High	5795	5855~5875	-48.03	≤10.25	PASS
11AC40M IMO	Ant1	High	5795	5875~5925	-47.86	≤-25.85	PASS
11AC40M IMO	Ant1	High	5795	5925~5935	-48.47	≤-27	PASS
11AC40M IMO	Ant2	High	5795	5850~5855	-48.32	≤15.66	PASS
11AC40M IMO	Ant2	High	5795	5855~5875	-48.4	≤10.71	PASS
11AC40M IMO	Ant2	High	5795	5875~5925	-49.73	≤-26.83	PASS
11AC40M IMO	Ant2	High	5795	5925~5935	-48.54	≤-27	PASS
11AC80M IMO	Ant1	Low	5775	5720~5725	-36.69	≤15.65	PASS
11AC80M IMO	Ant1	Low	5775	5700~5720	-40.4	≤10.92	PASS
11AC80M IMO	Ant1	Low	5775	5650~5700	-46.98	≤-25.88	PASS
11AC80M IMO	Ant1	Low	5775	5800~5650	-47.39	≤-27	PASS
11AC80M IMO	Ant1	High	5775	5850~5855	-44.48	≤15.84	PASS
11AC80M IMO	Ant1	High	5775	5855~5875	-47	≤10.50	PASS
11AC80M IMO	Ant1	High	5775	5875~5925	-48.1	≤-26.19	PASS
11AC80M IMO	Ant1	High	5775	5925~5935	-48.43	≤-27	PASS
11AC80M IMO	Ant2	Low	5775	5720~5725	-37	≤16.00	PASS
11AC80M IMO	Ant2	Low	5775	5700~5720	-39.57	≤10.83	PASS
11AC80M IMO	Ant2	Low	5775	5650~5700	-47.38	≤-25.19	PASS
11AC80M IMO	Ant2	Low	5775	5800~5650	-47.47	≤-27	PASS
11AC80M IMO	Ant2	High	5775	5850~5855	-45.93	≤15.84	PASS
11AC80M IMO	Ant2	High	5775	5855~5875	-47.33	≤10.19	PASS
11AC80M	Ant2	High	5775	5875~5925	-49.22	≤-26.32	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


IMO							
11AC80M IMO	Ant2	High	5775	5925~5935	-48.74	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1

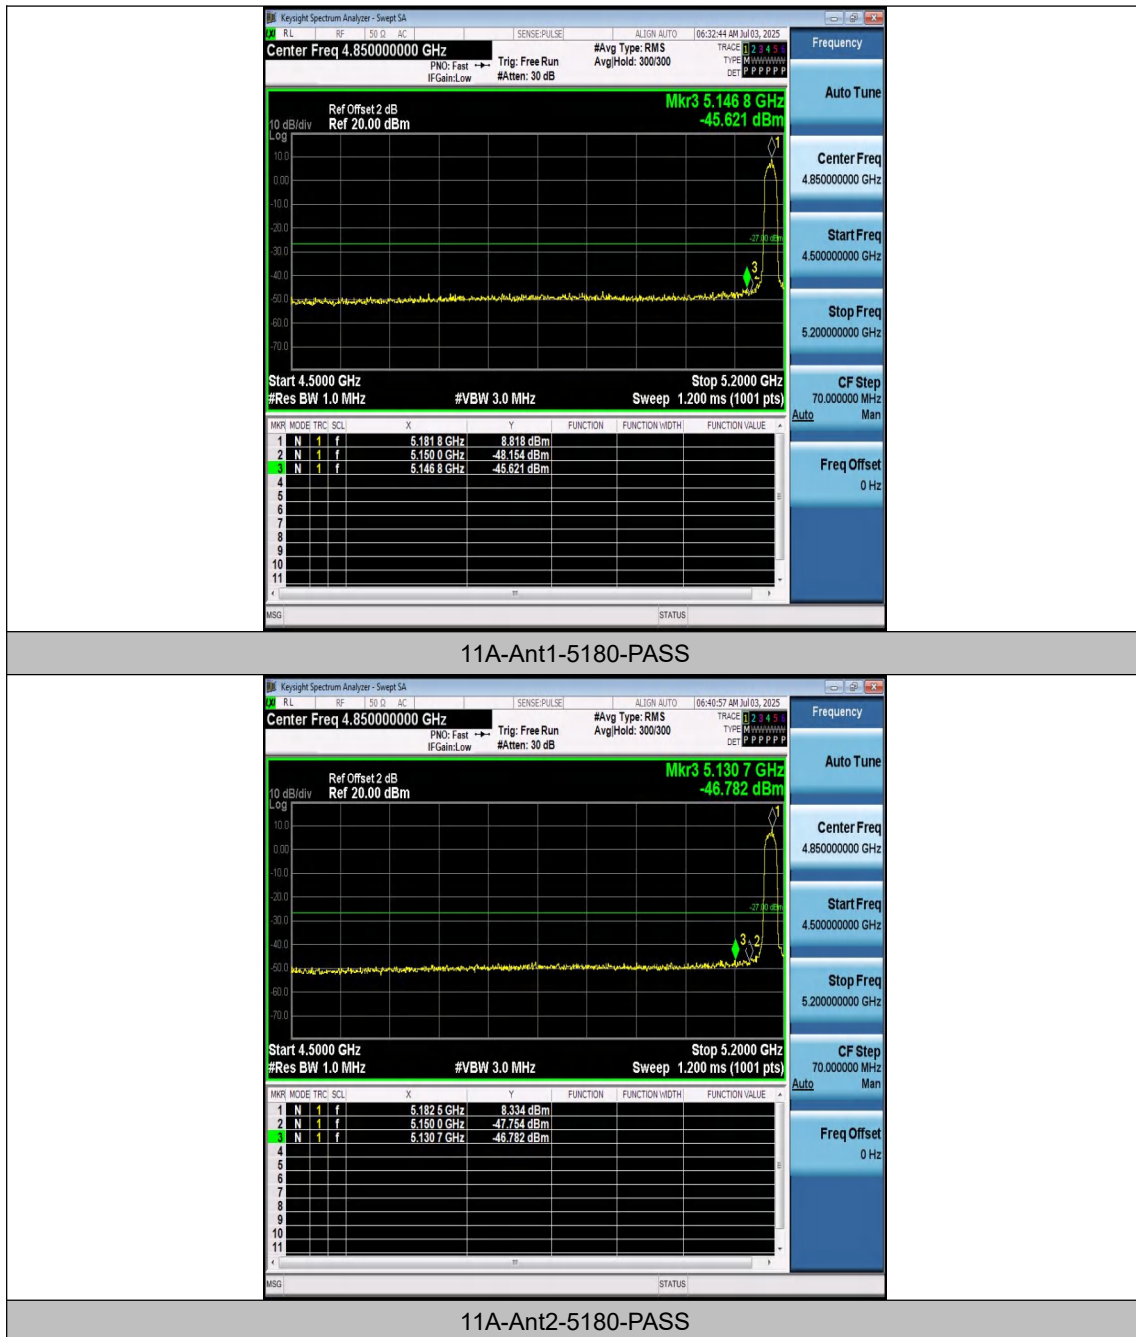


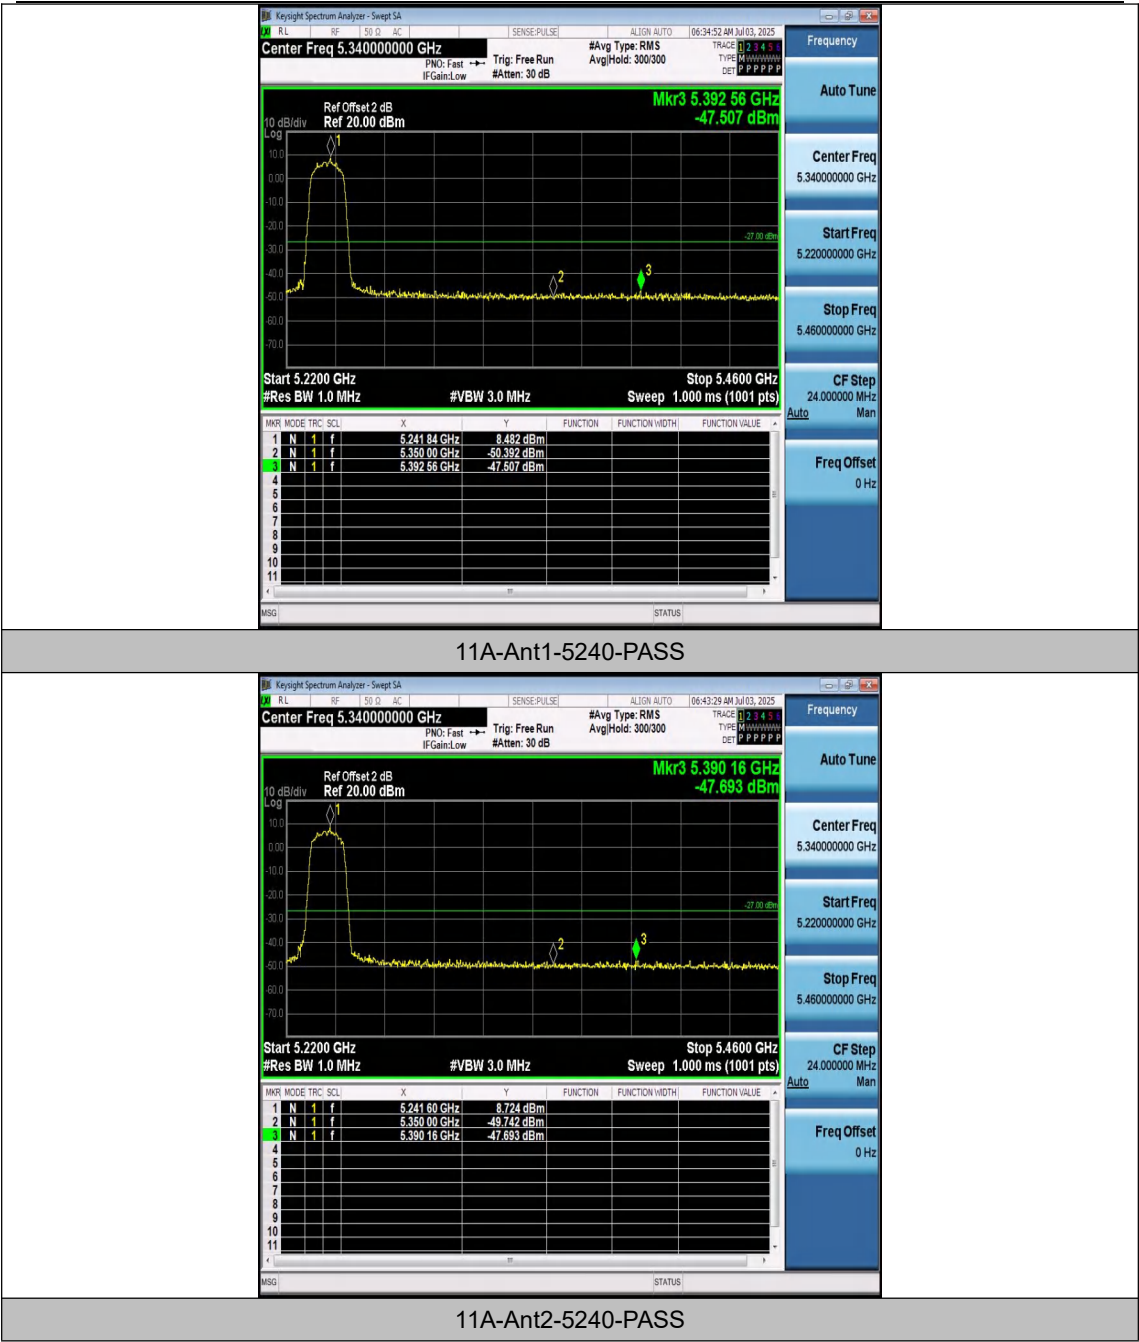

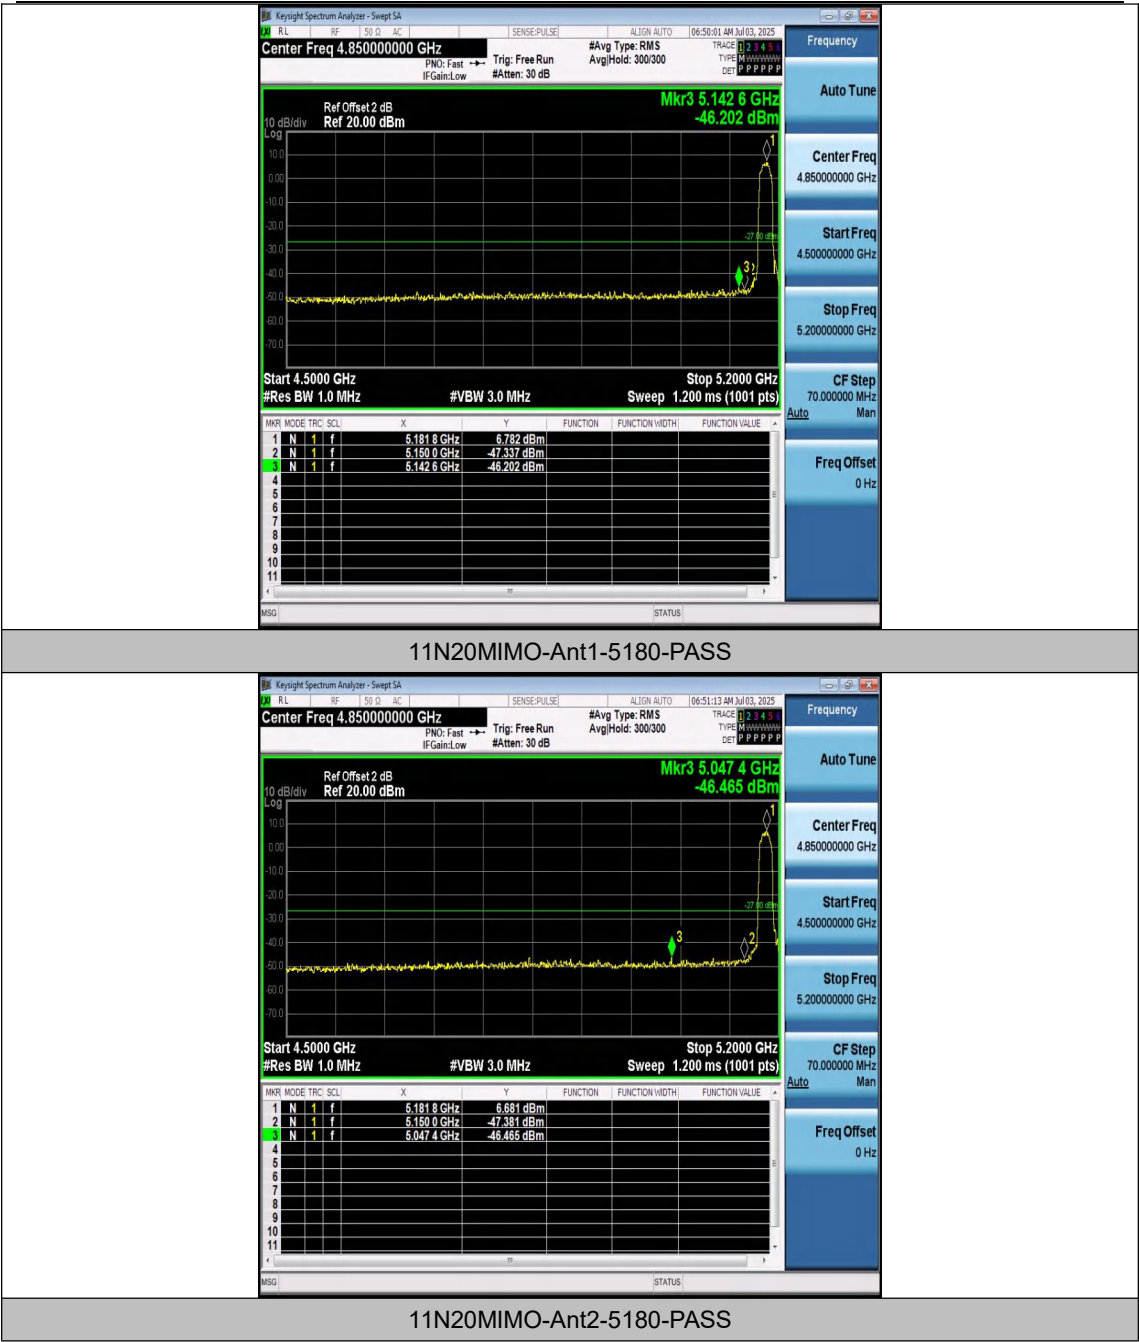

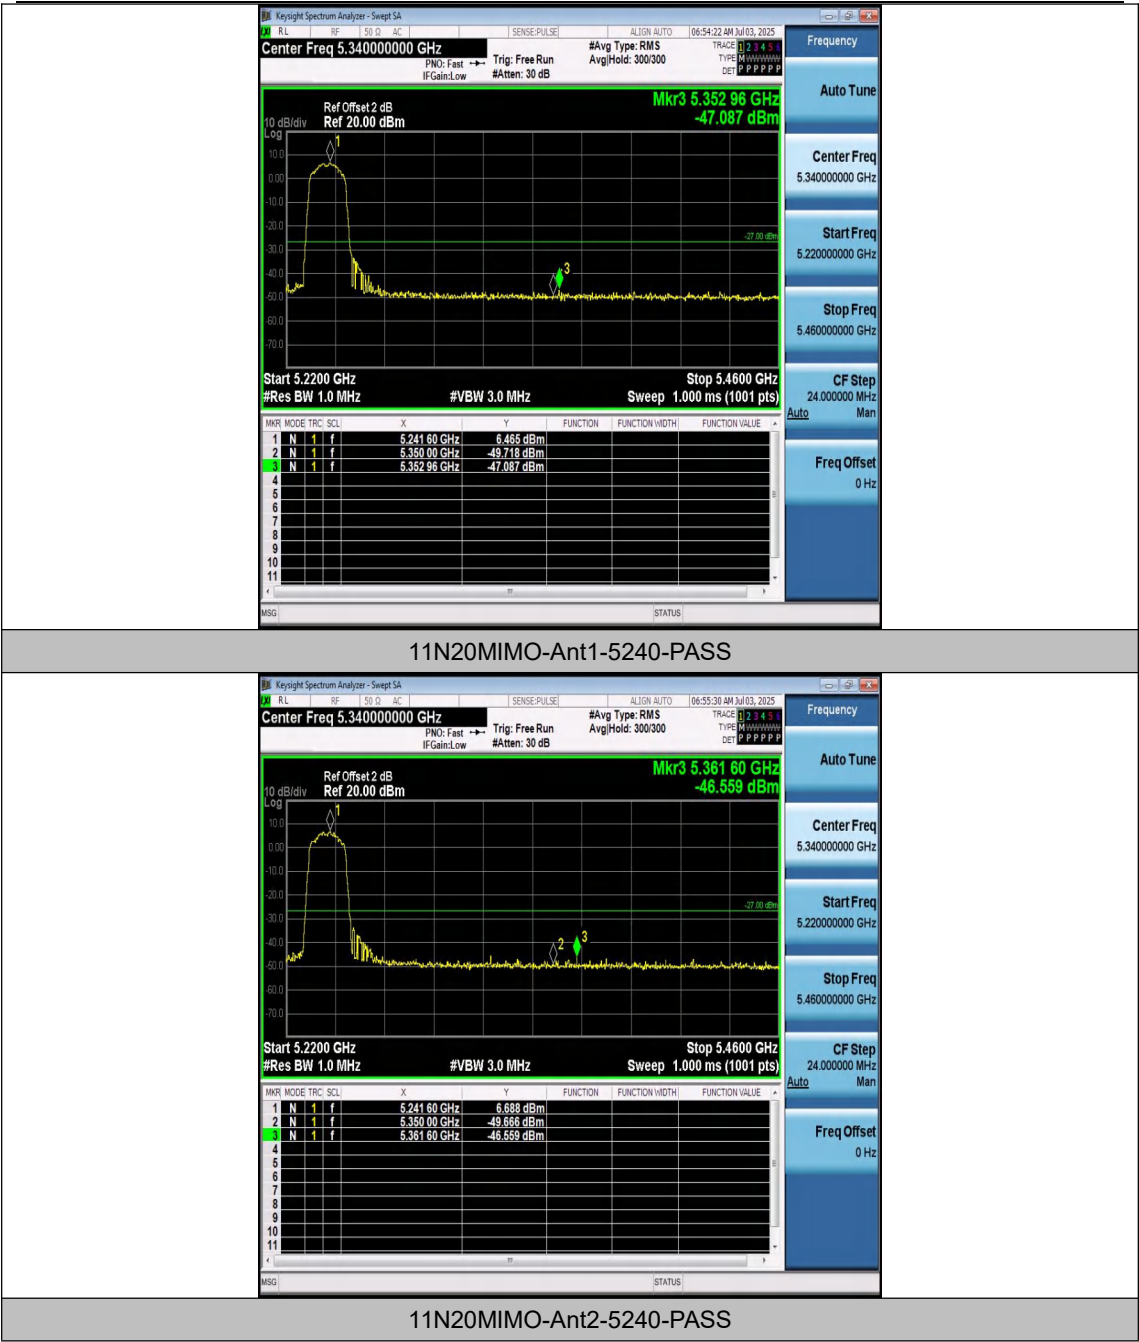

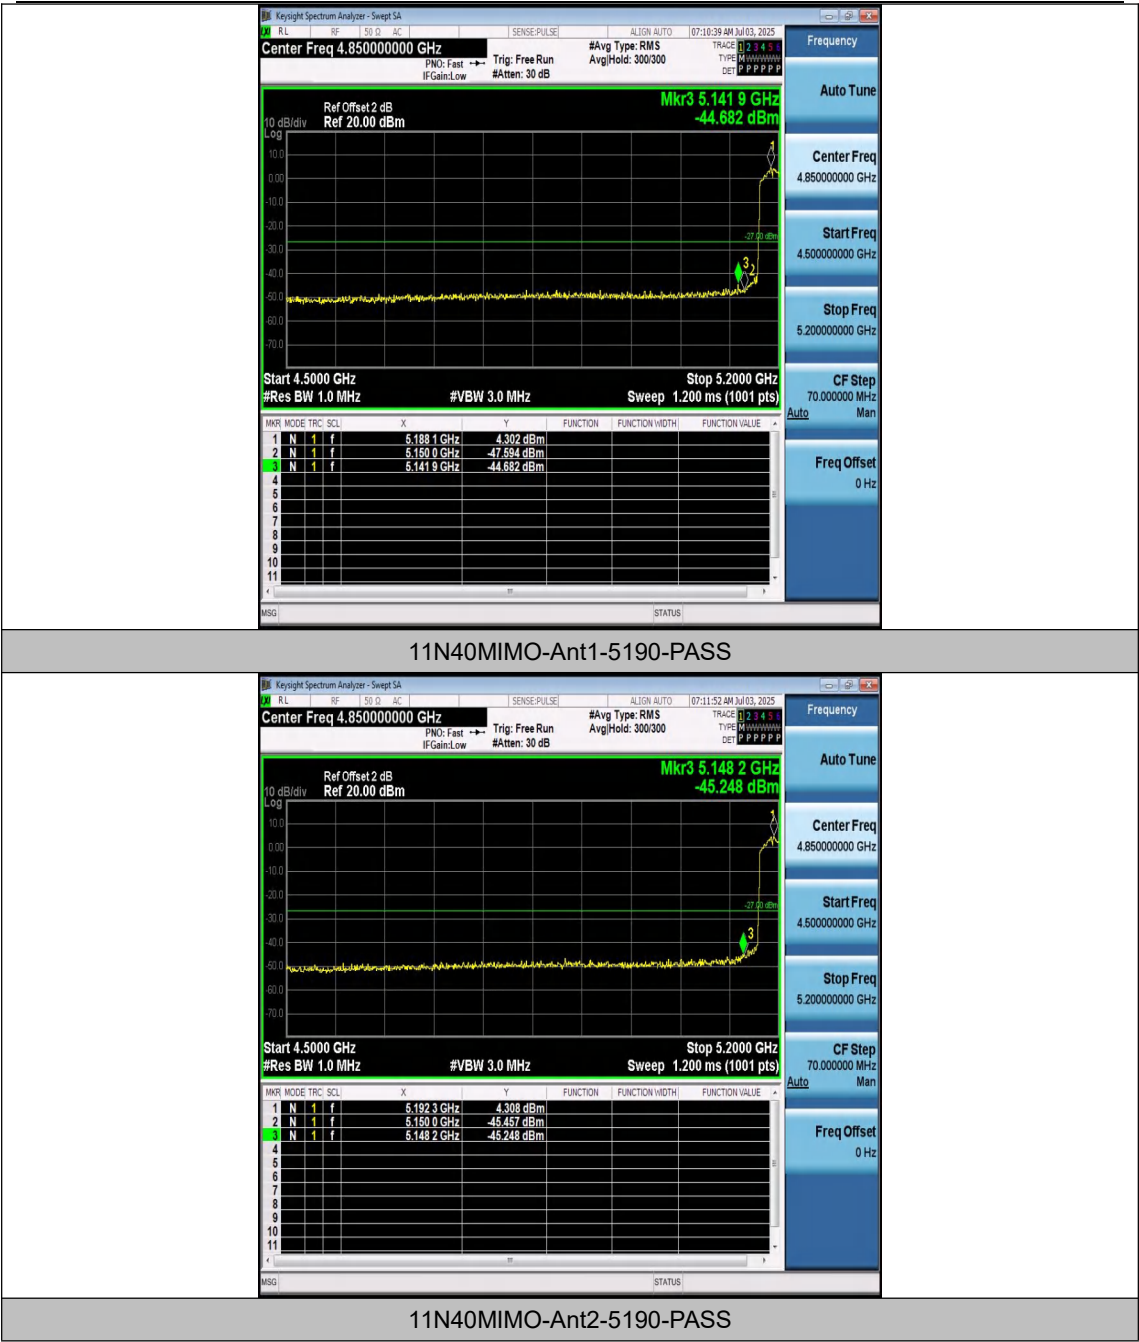


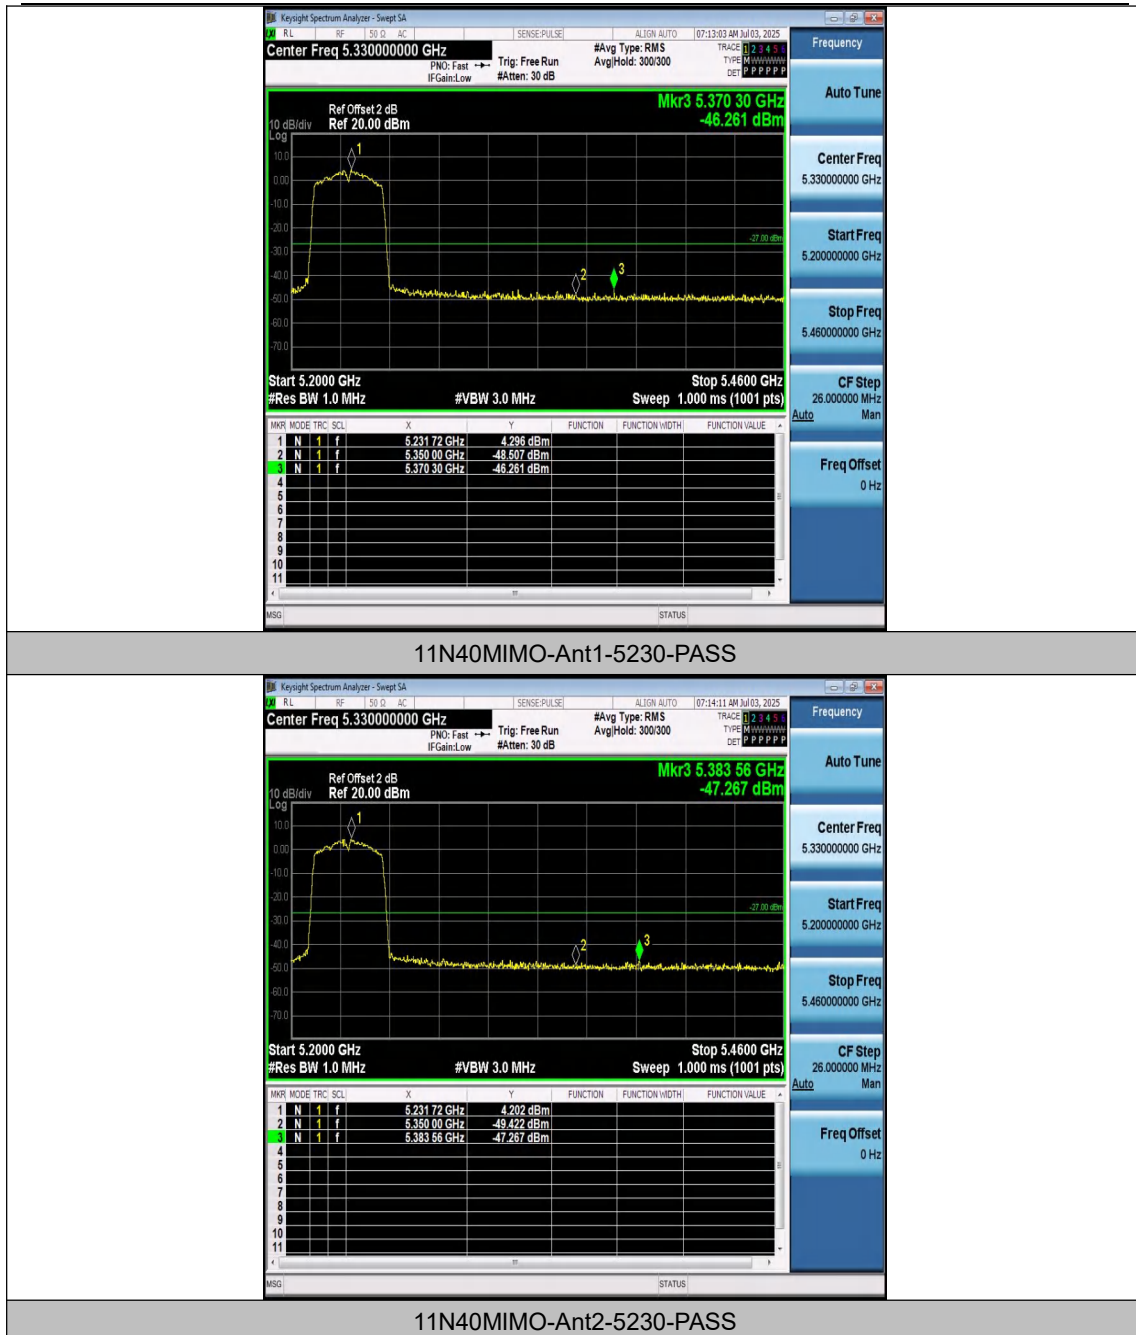



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

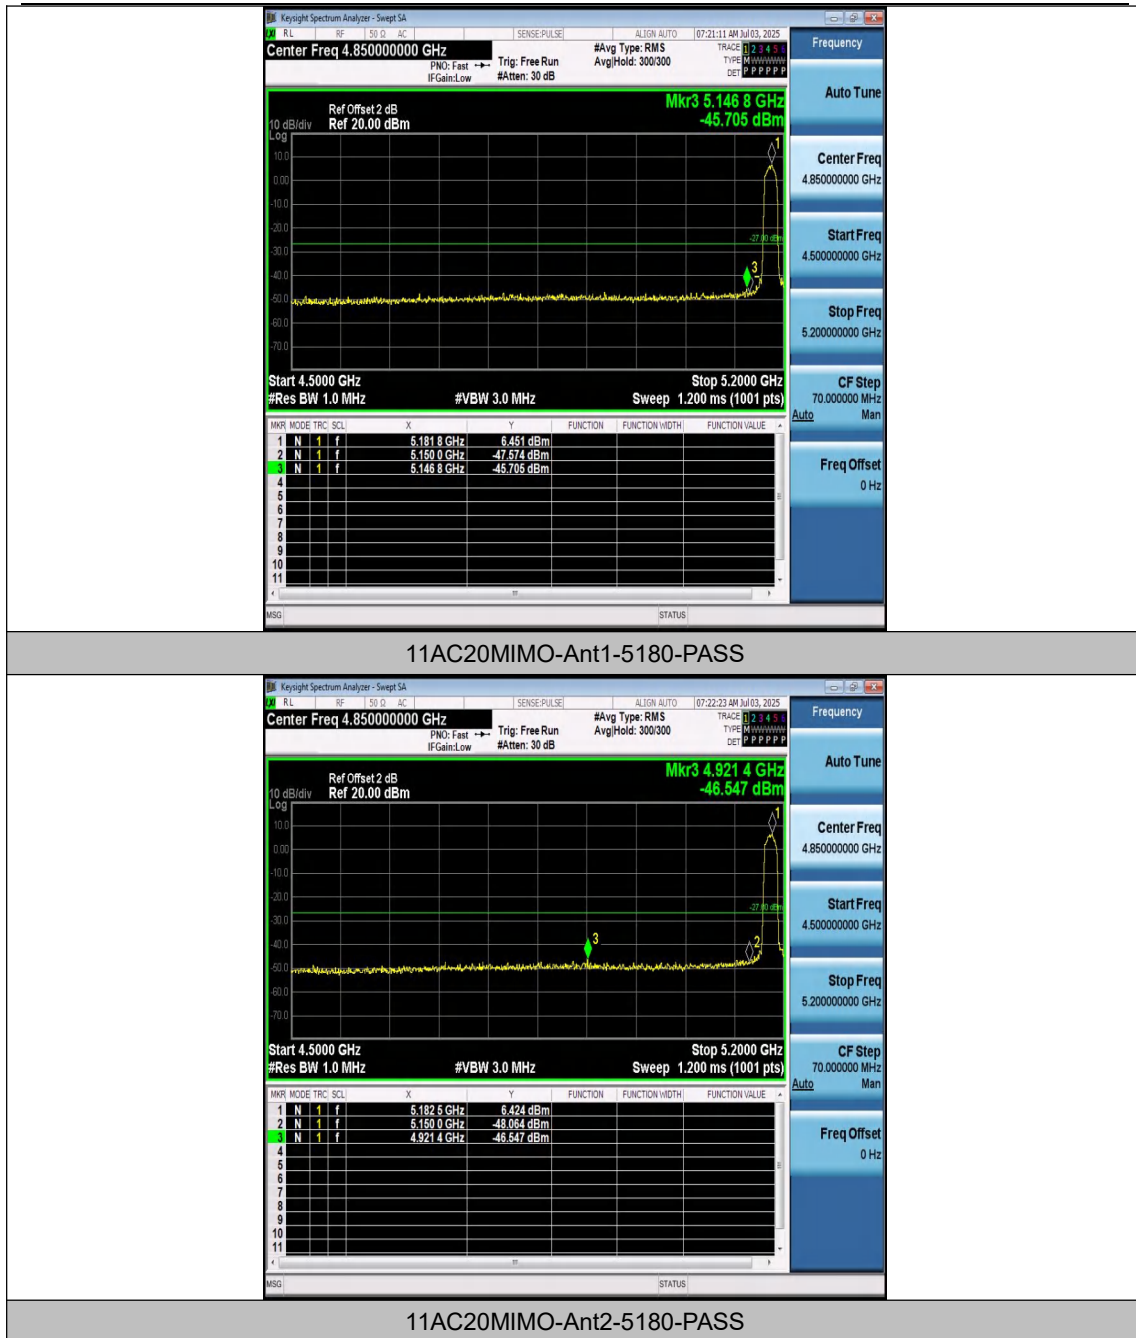


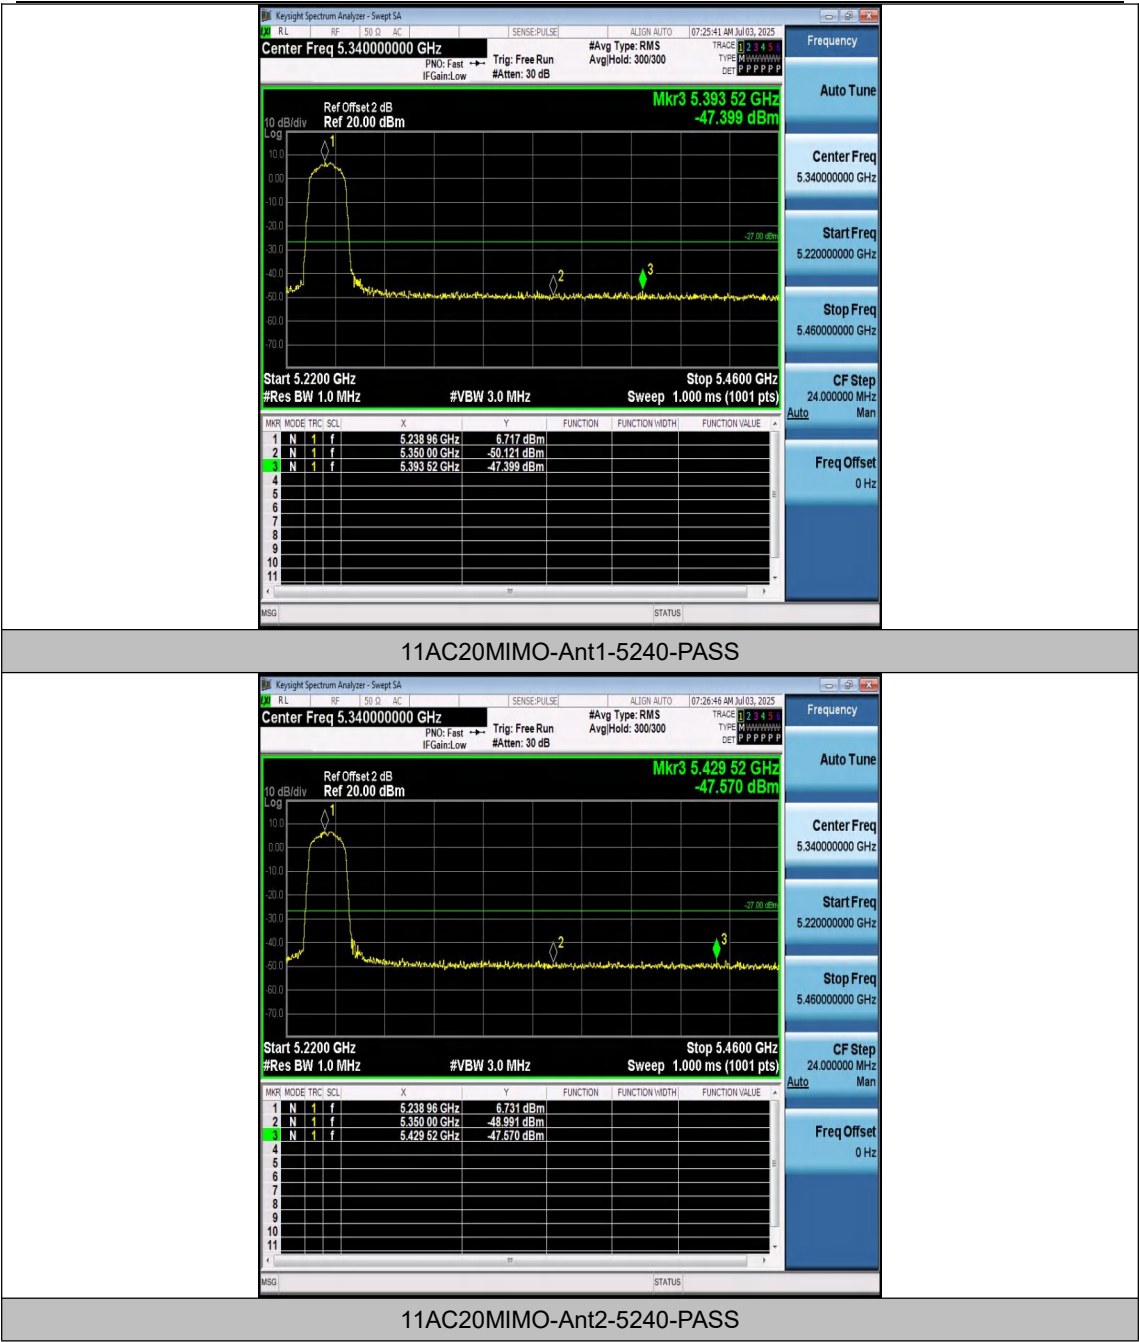

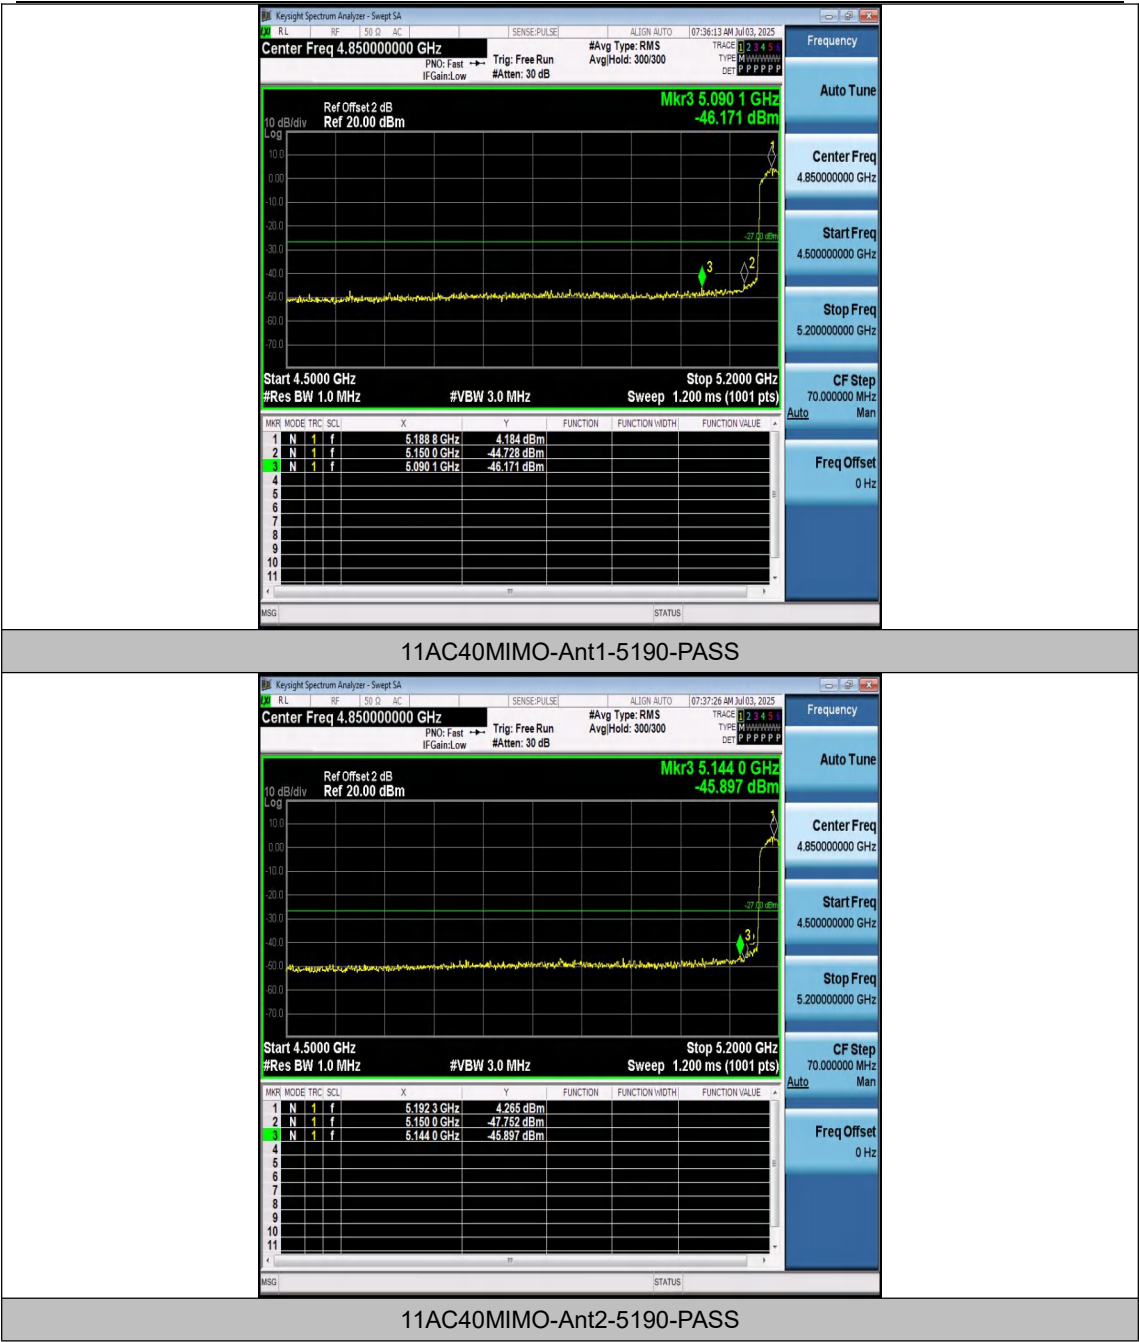


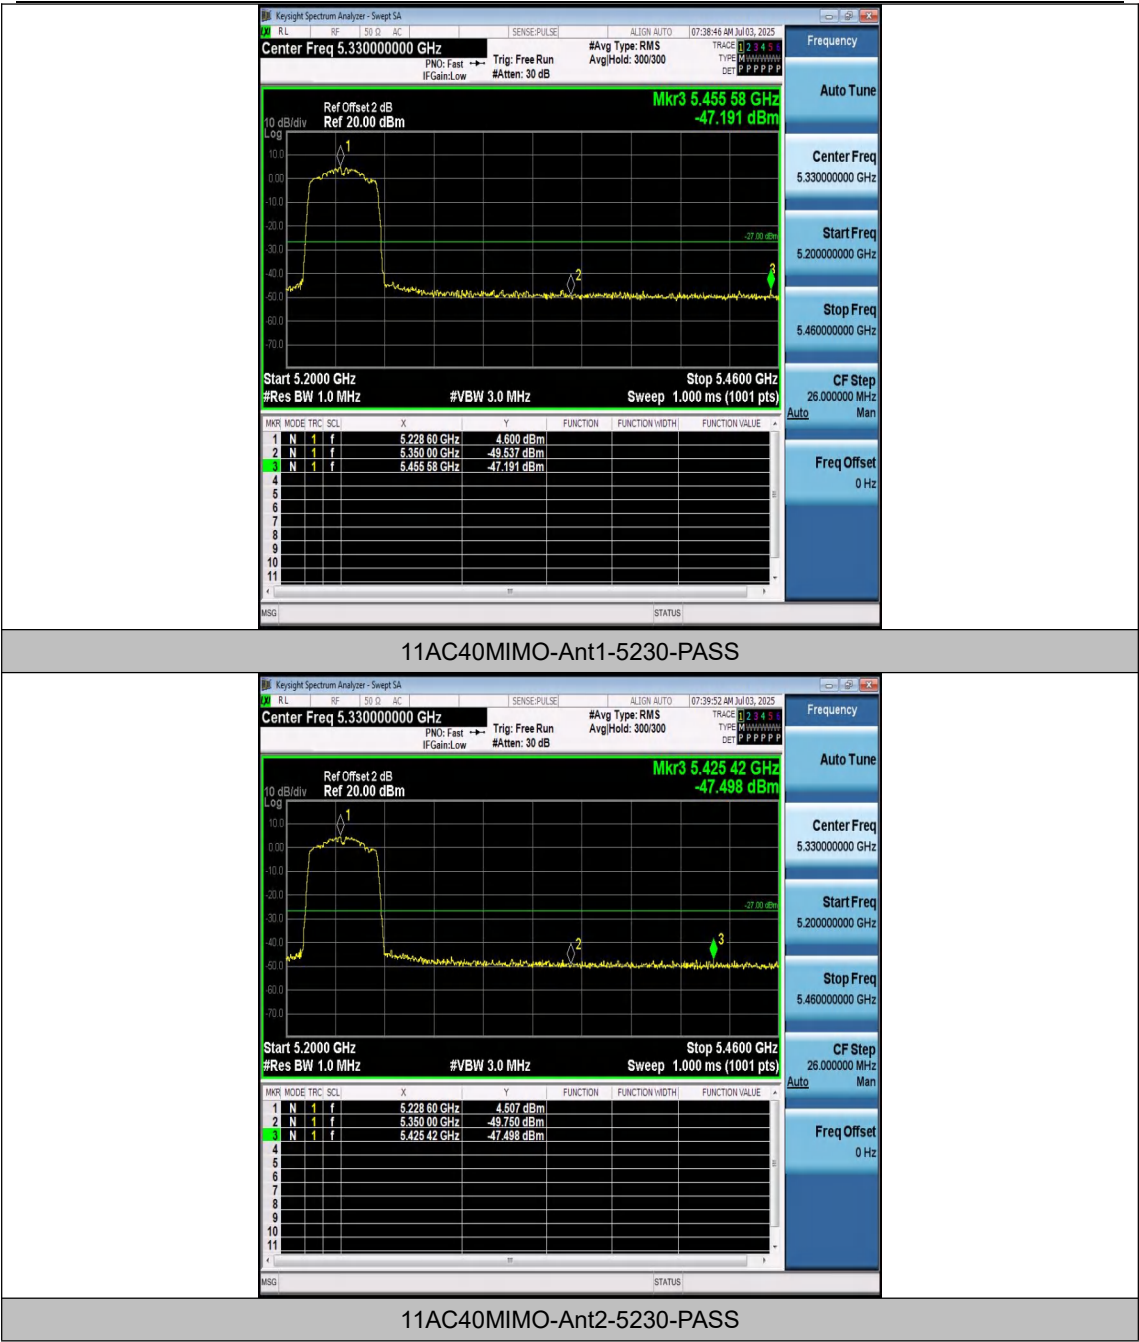

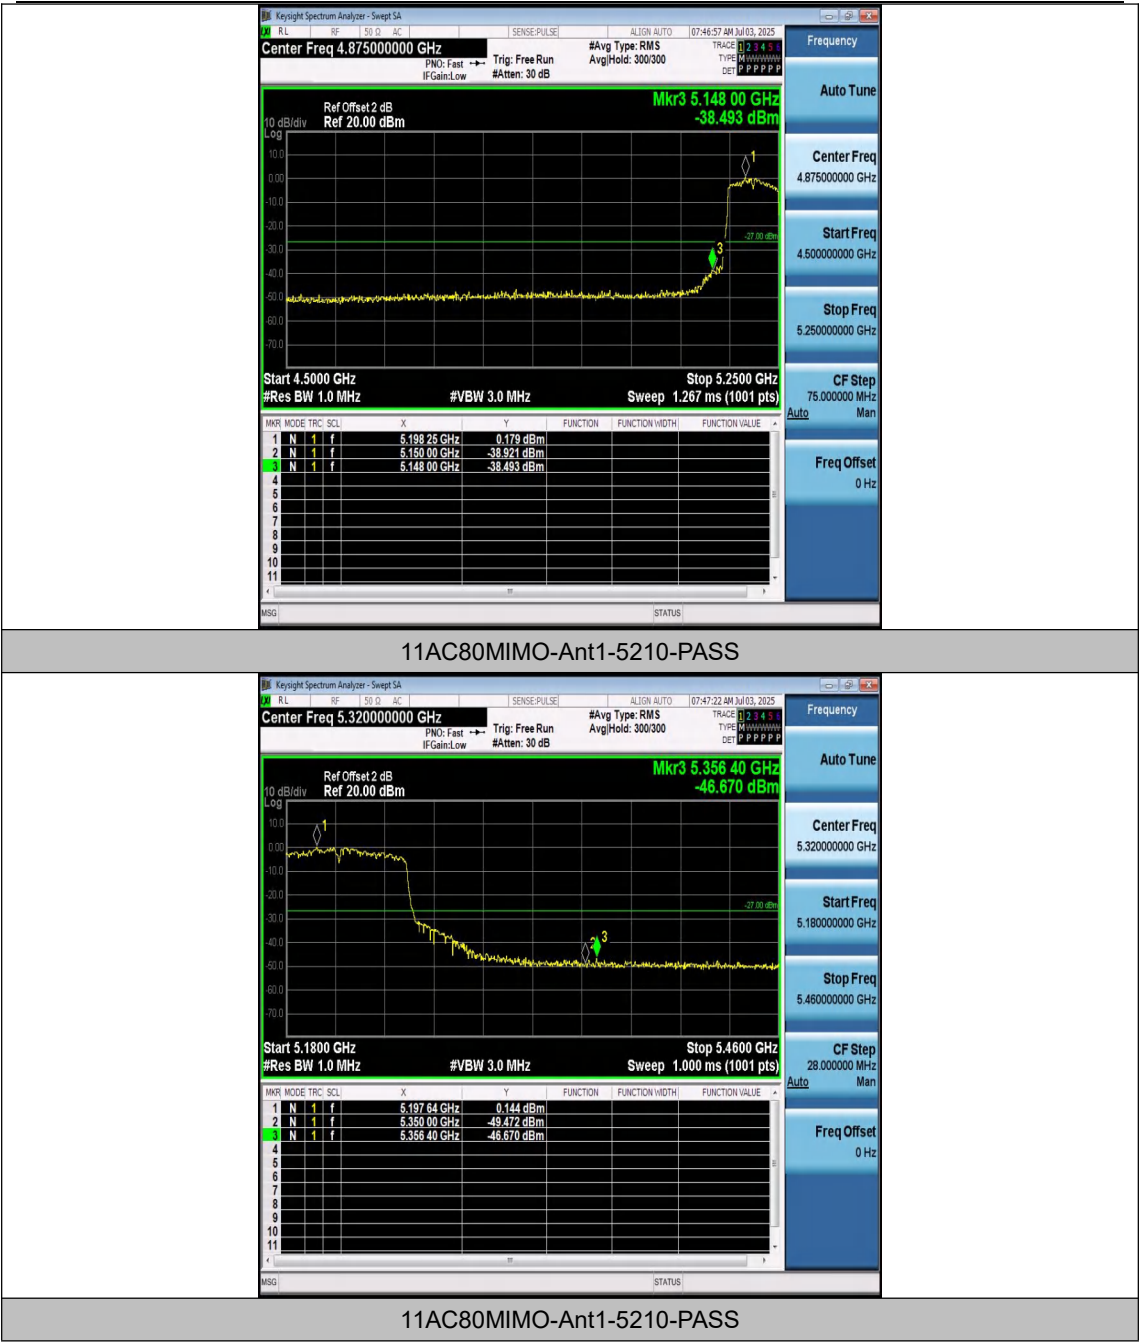

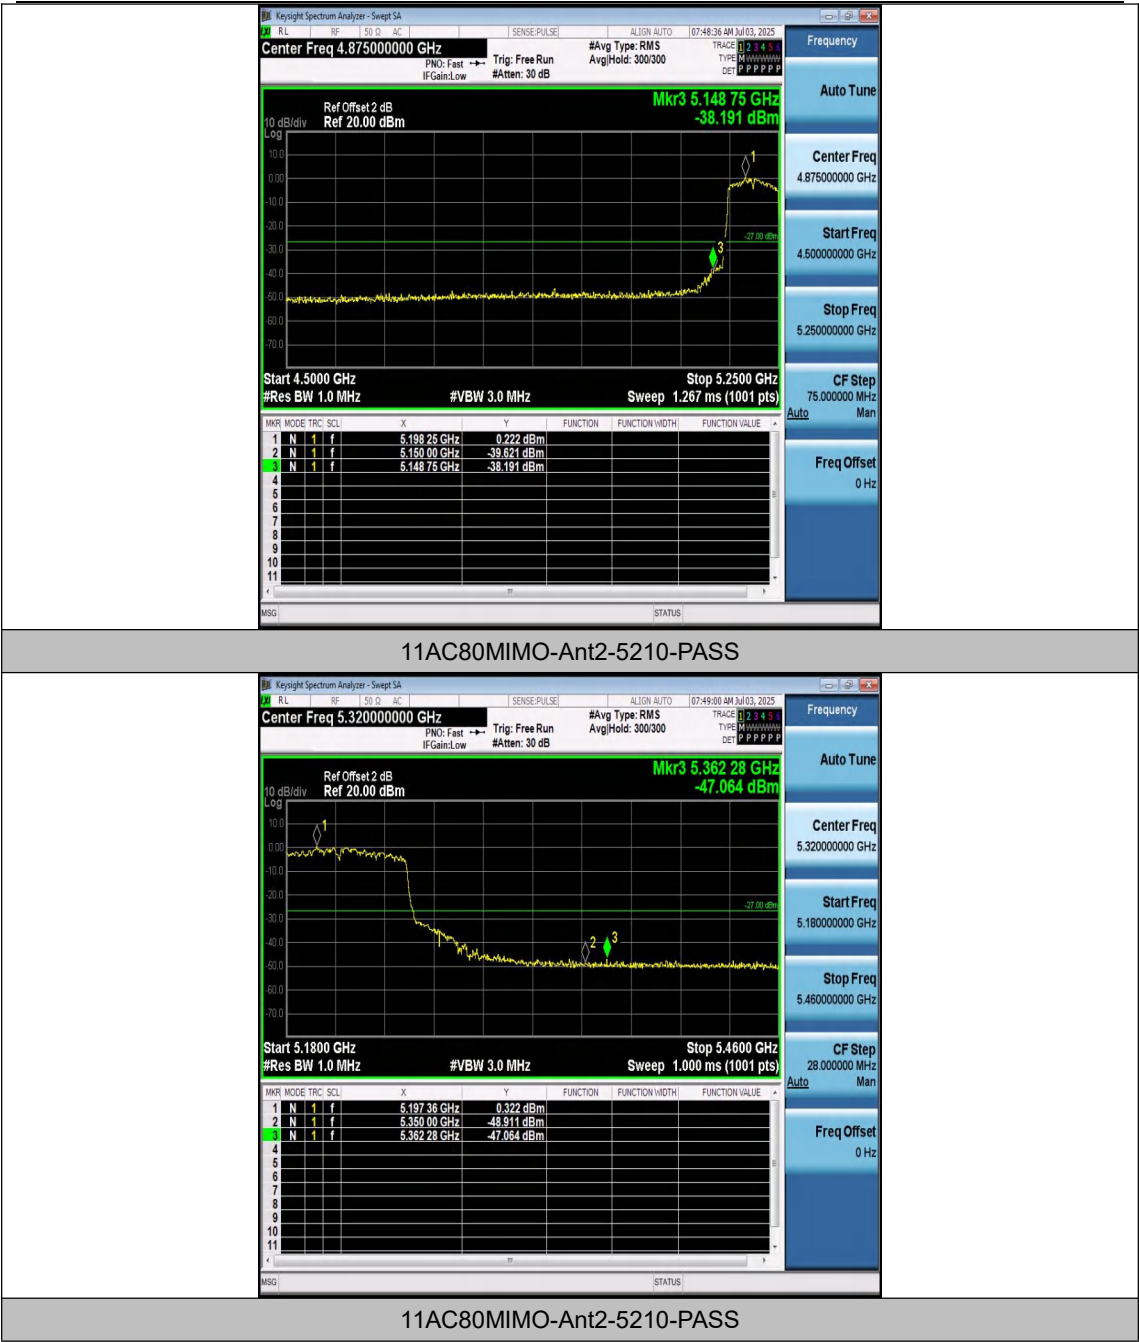


Test Graphs B4

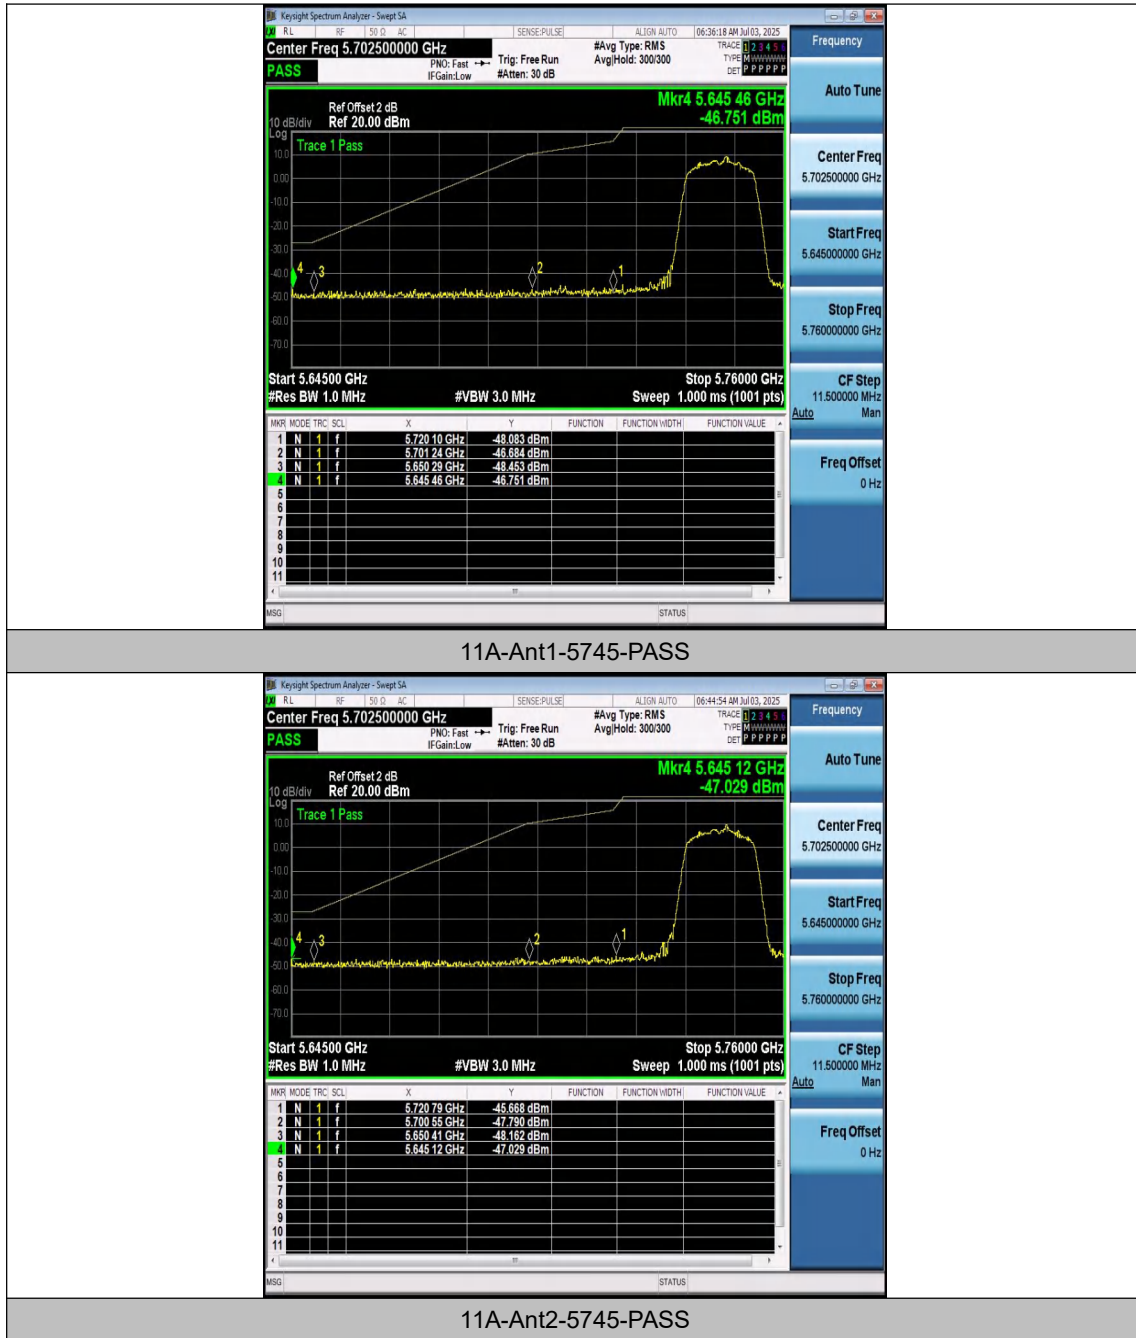

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

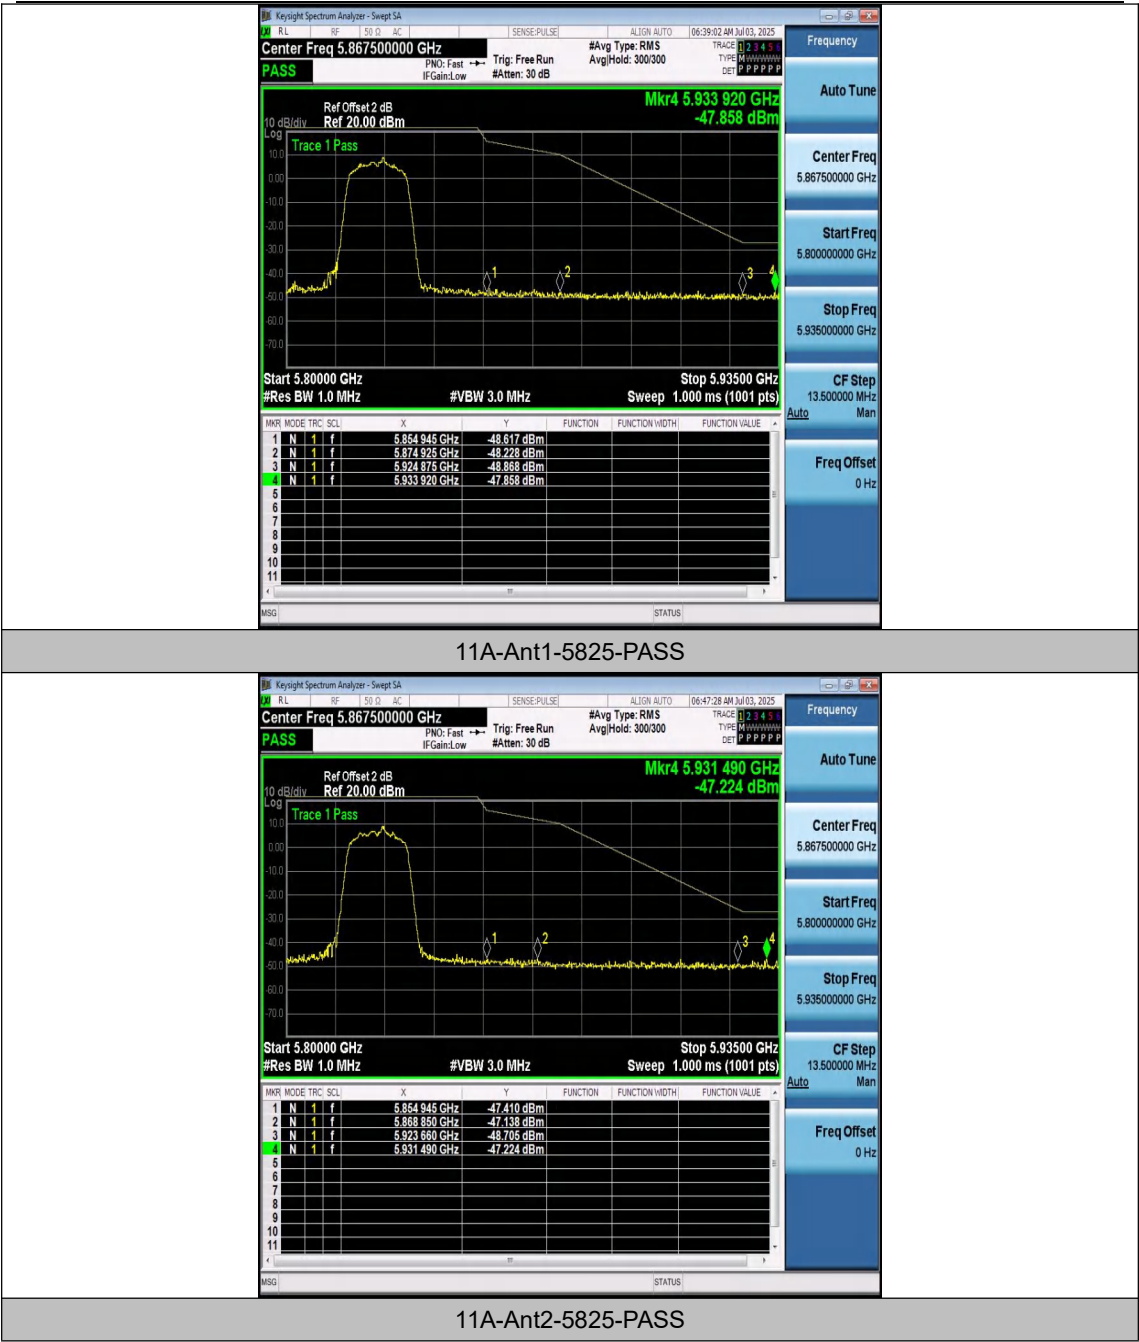


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

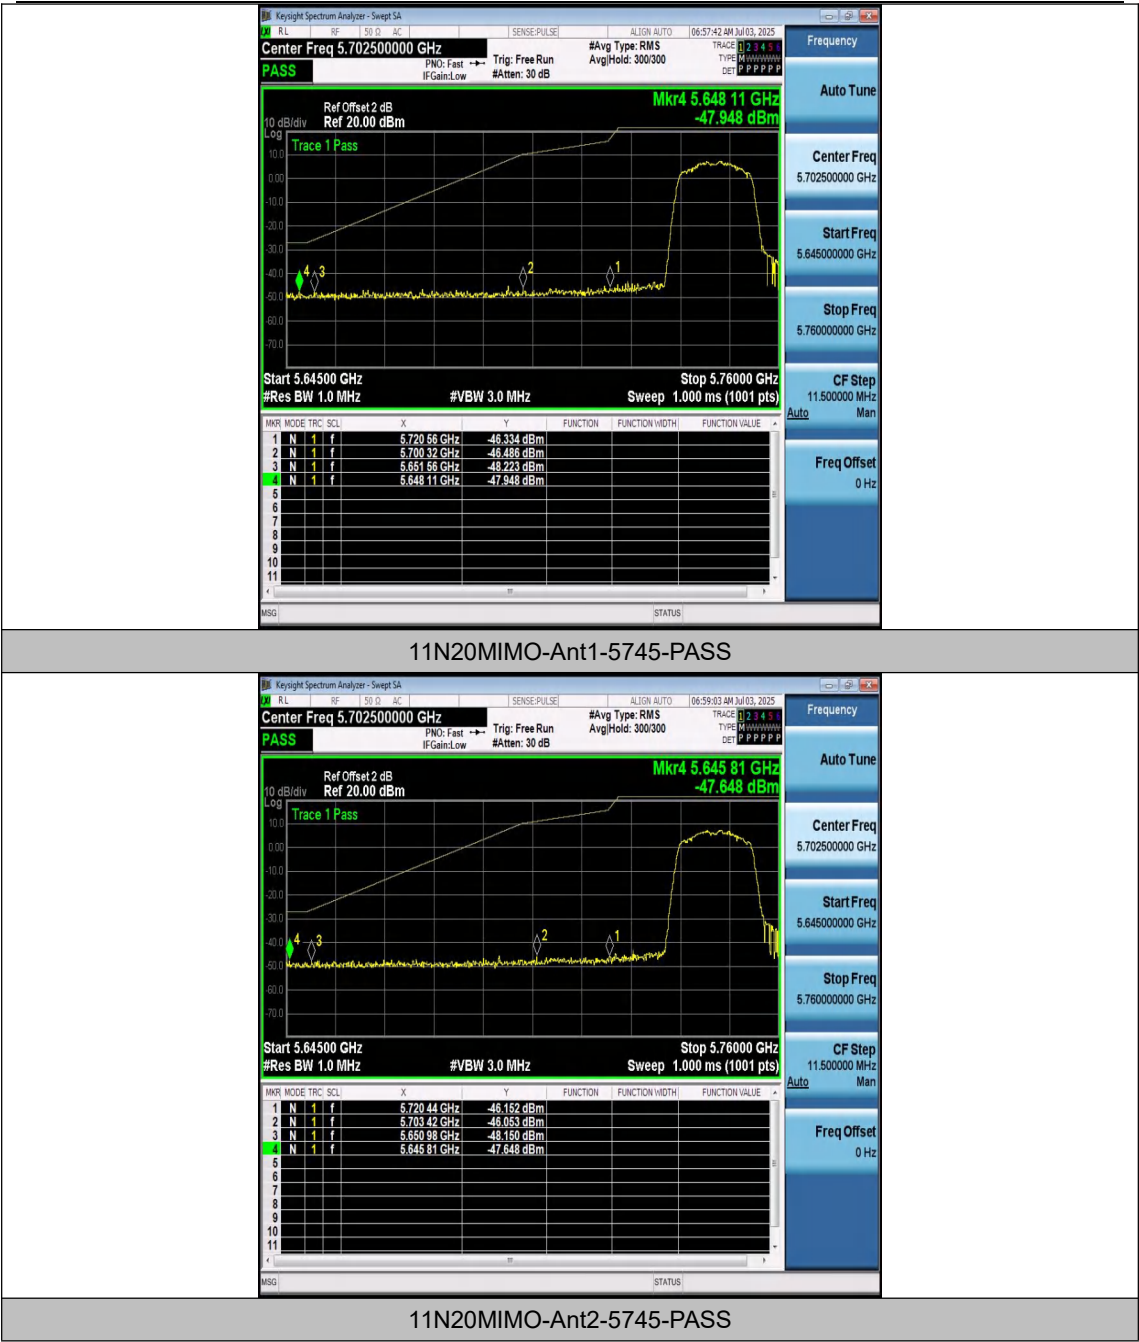

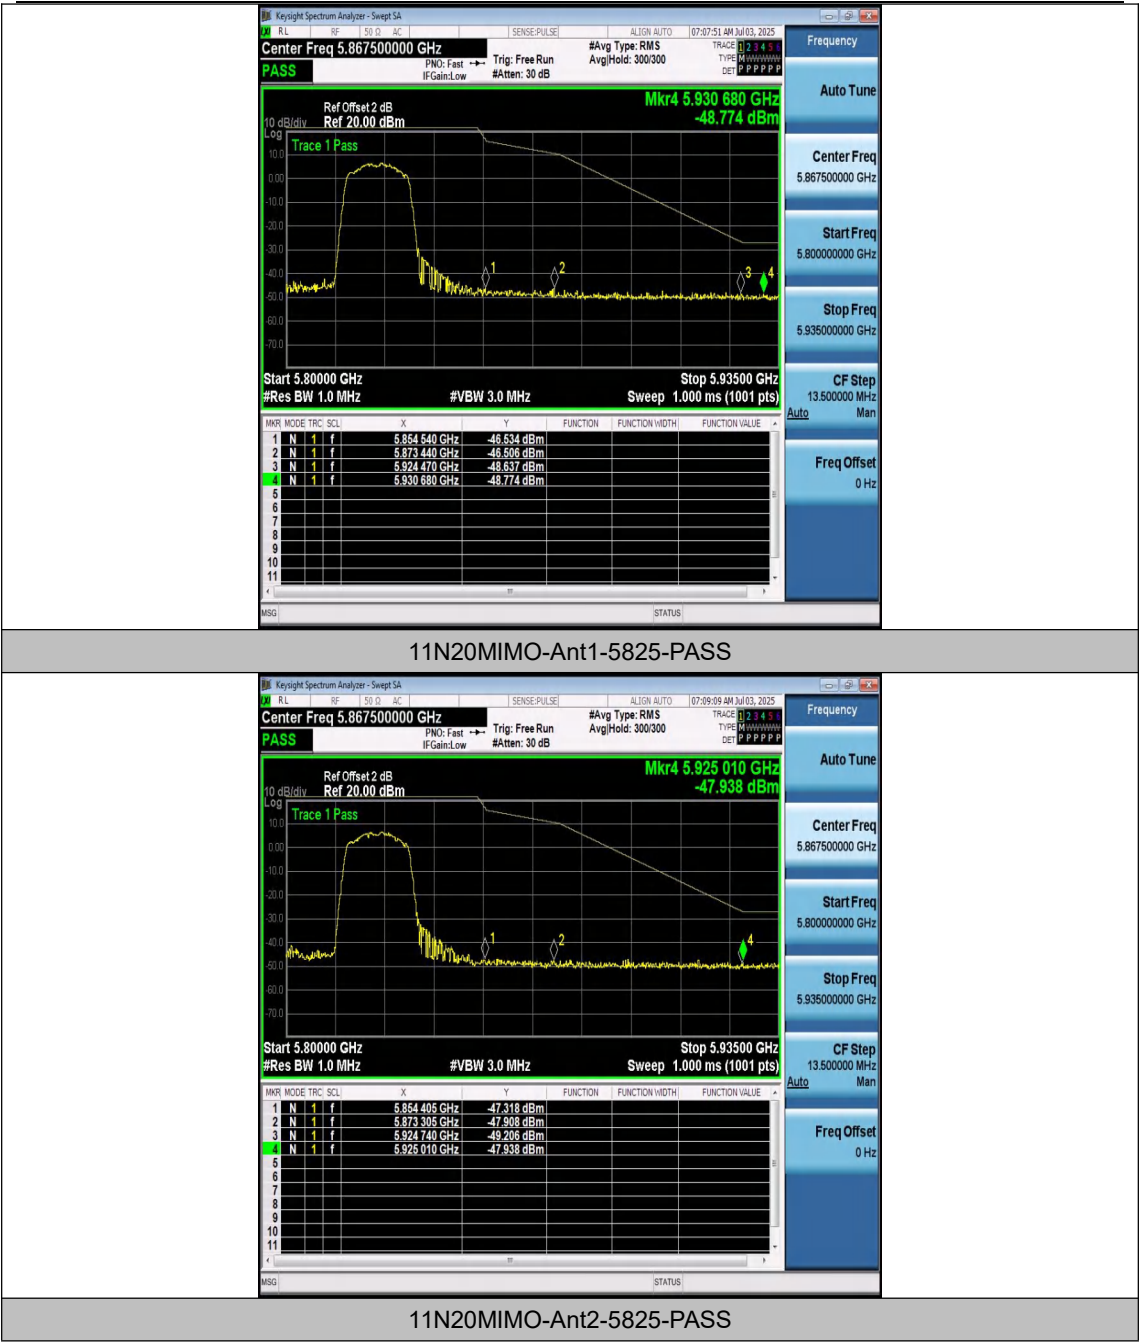


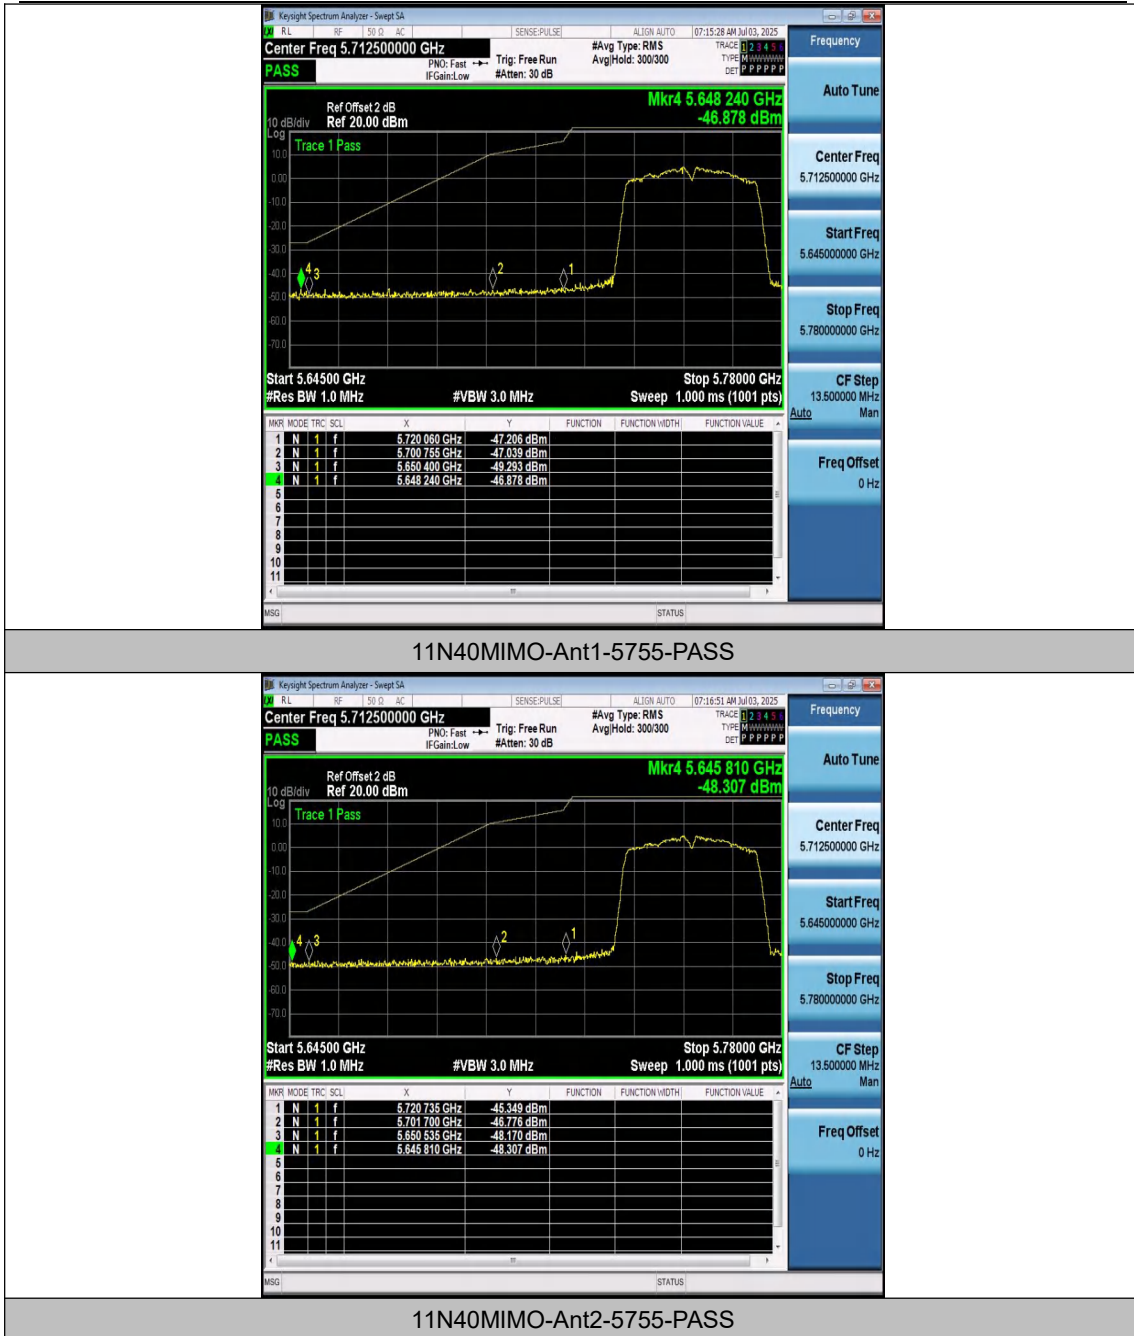



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

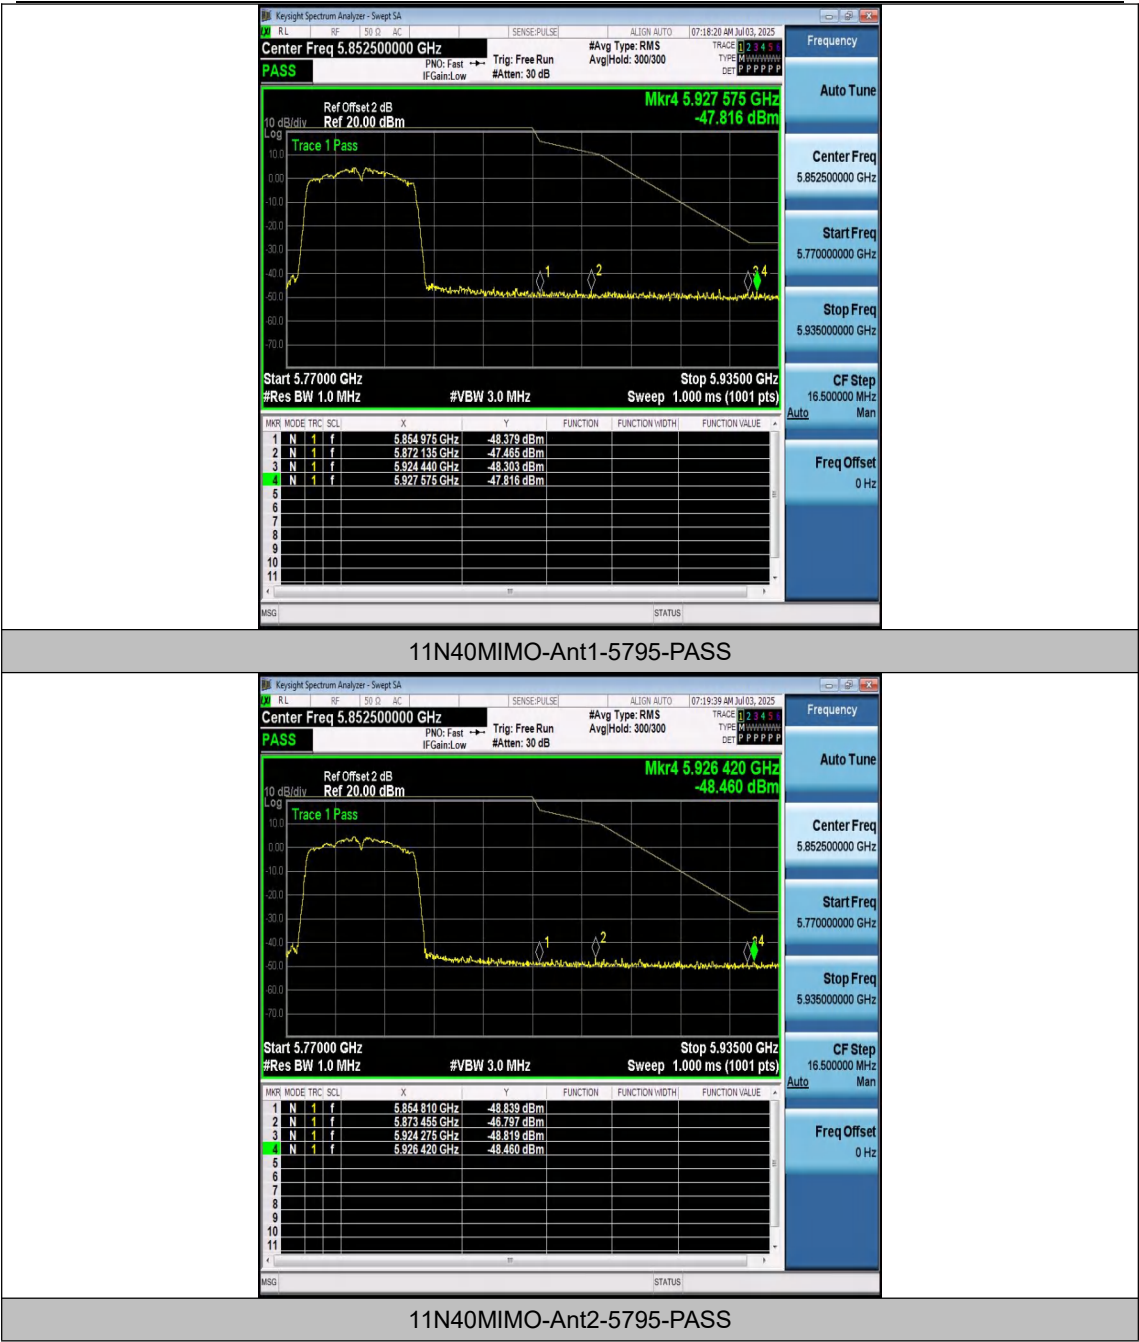

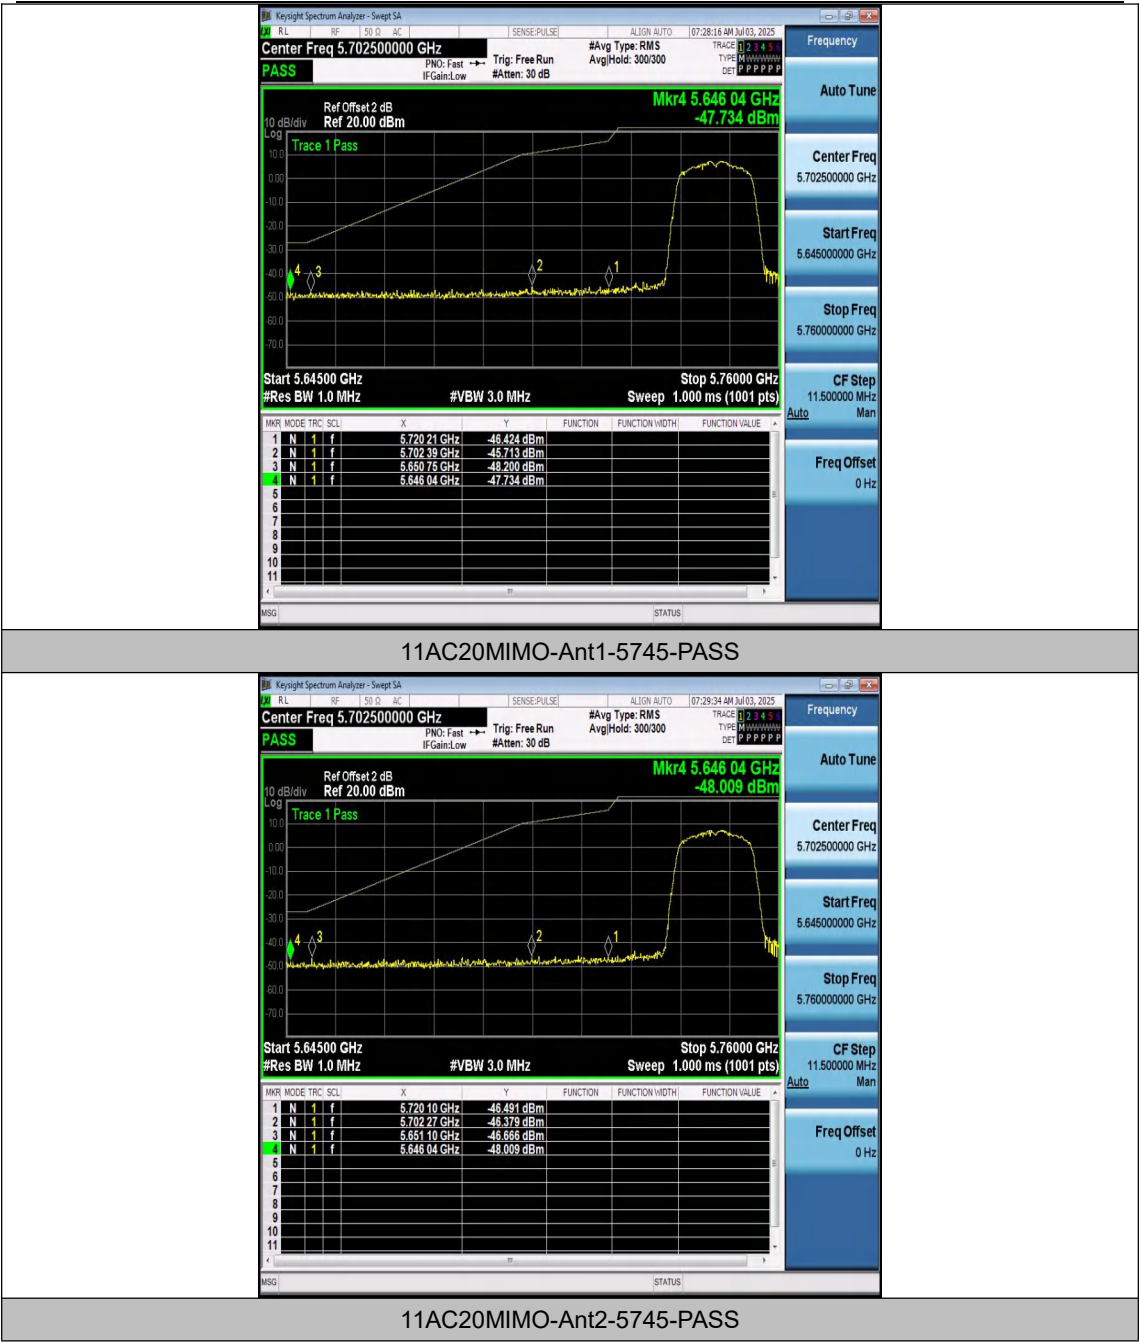


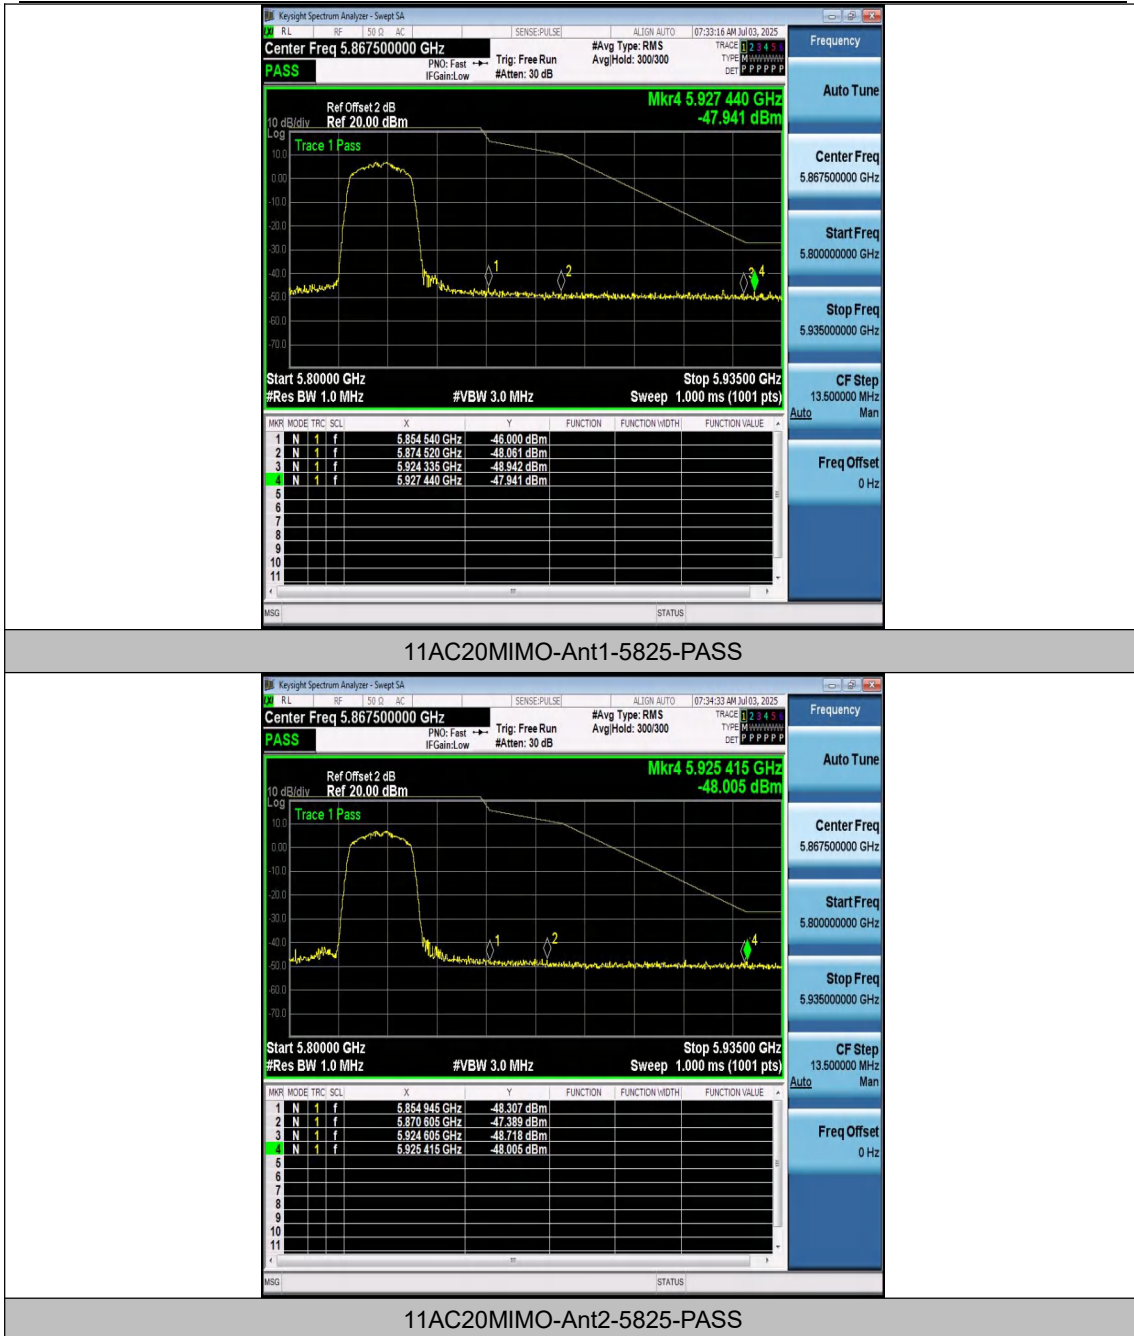

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

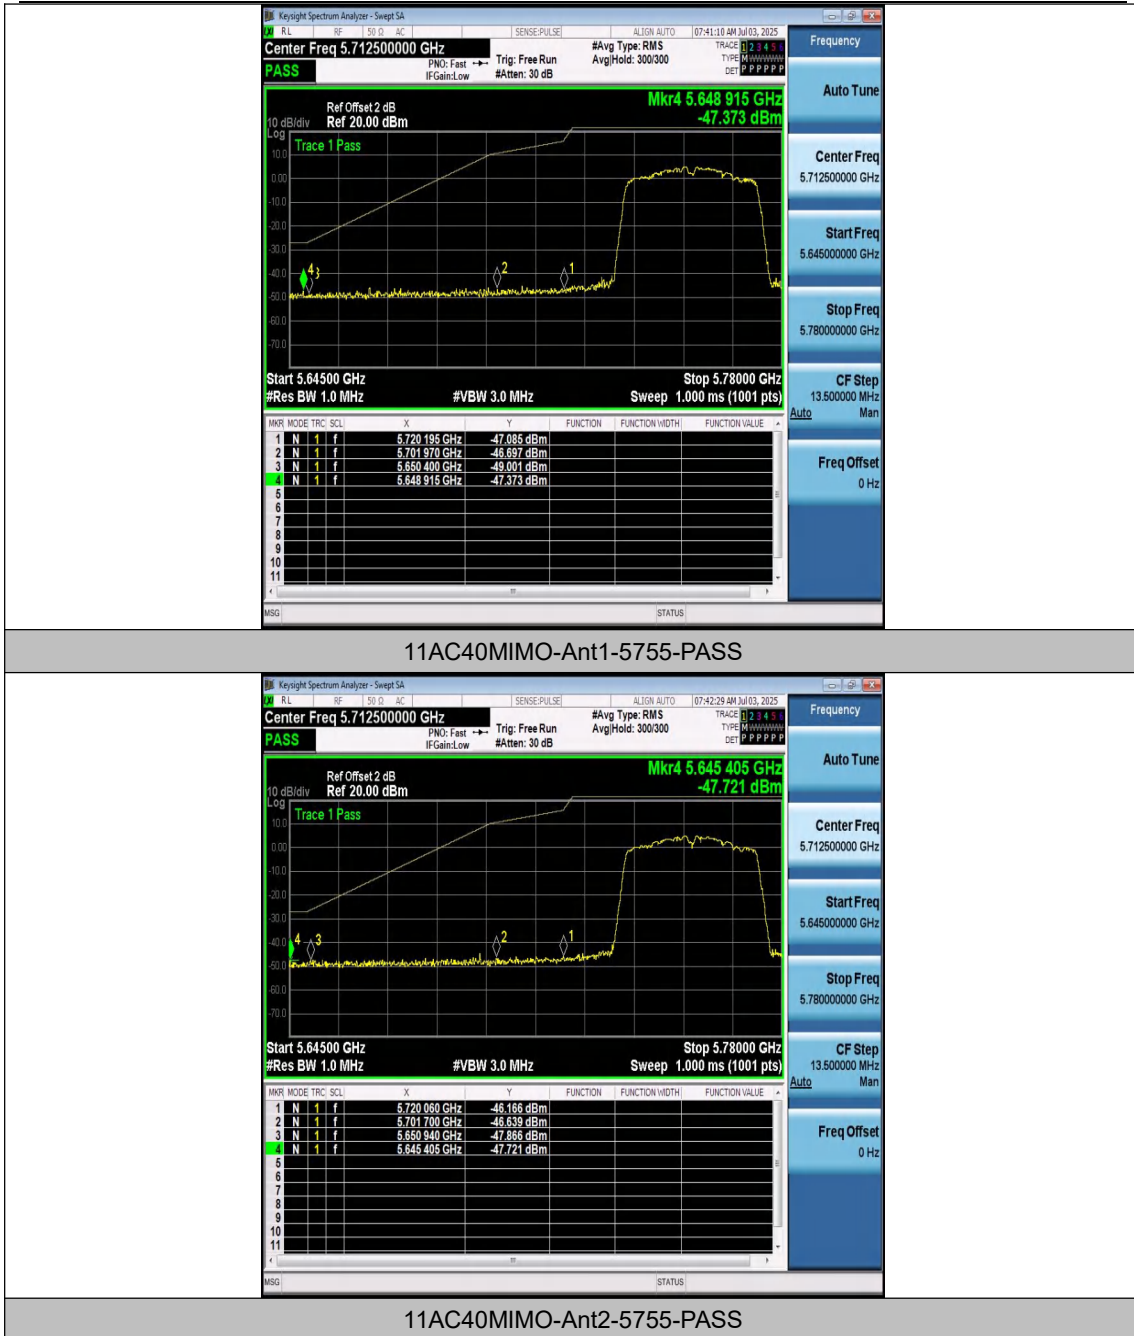

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

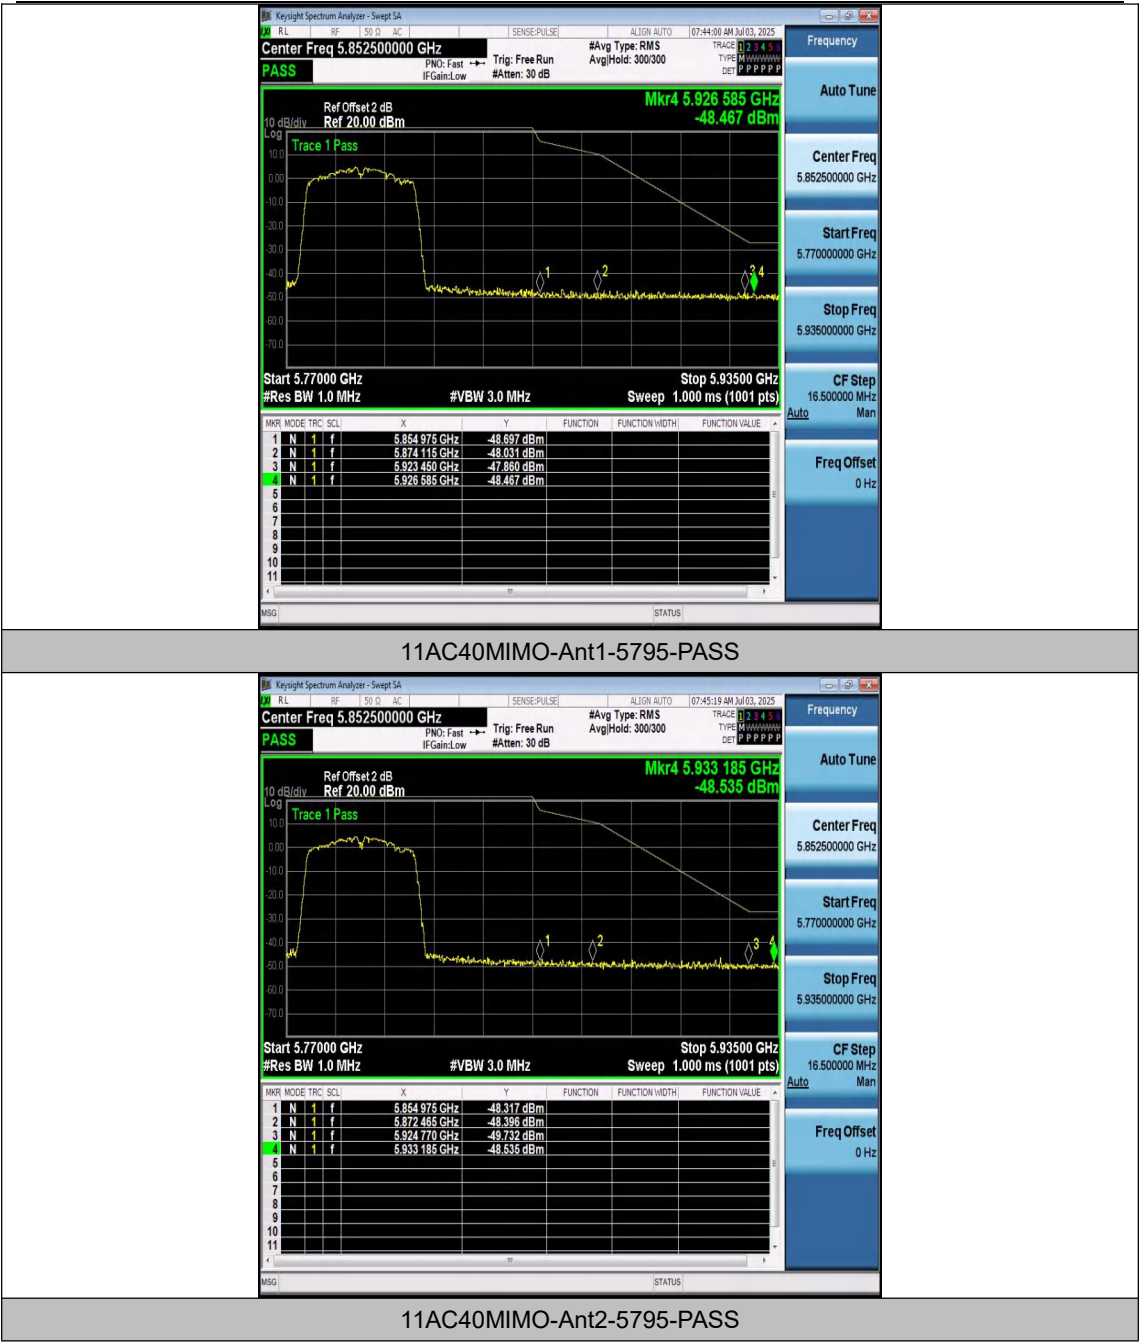

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

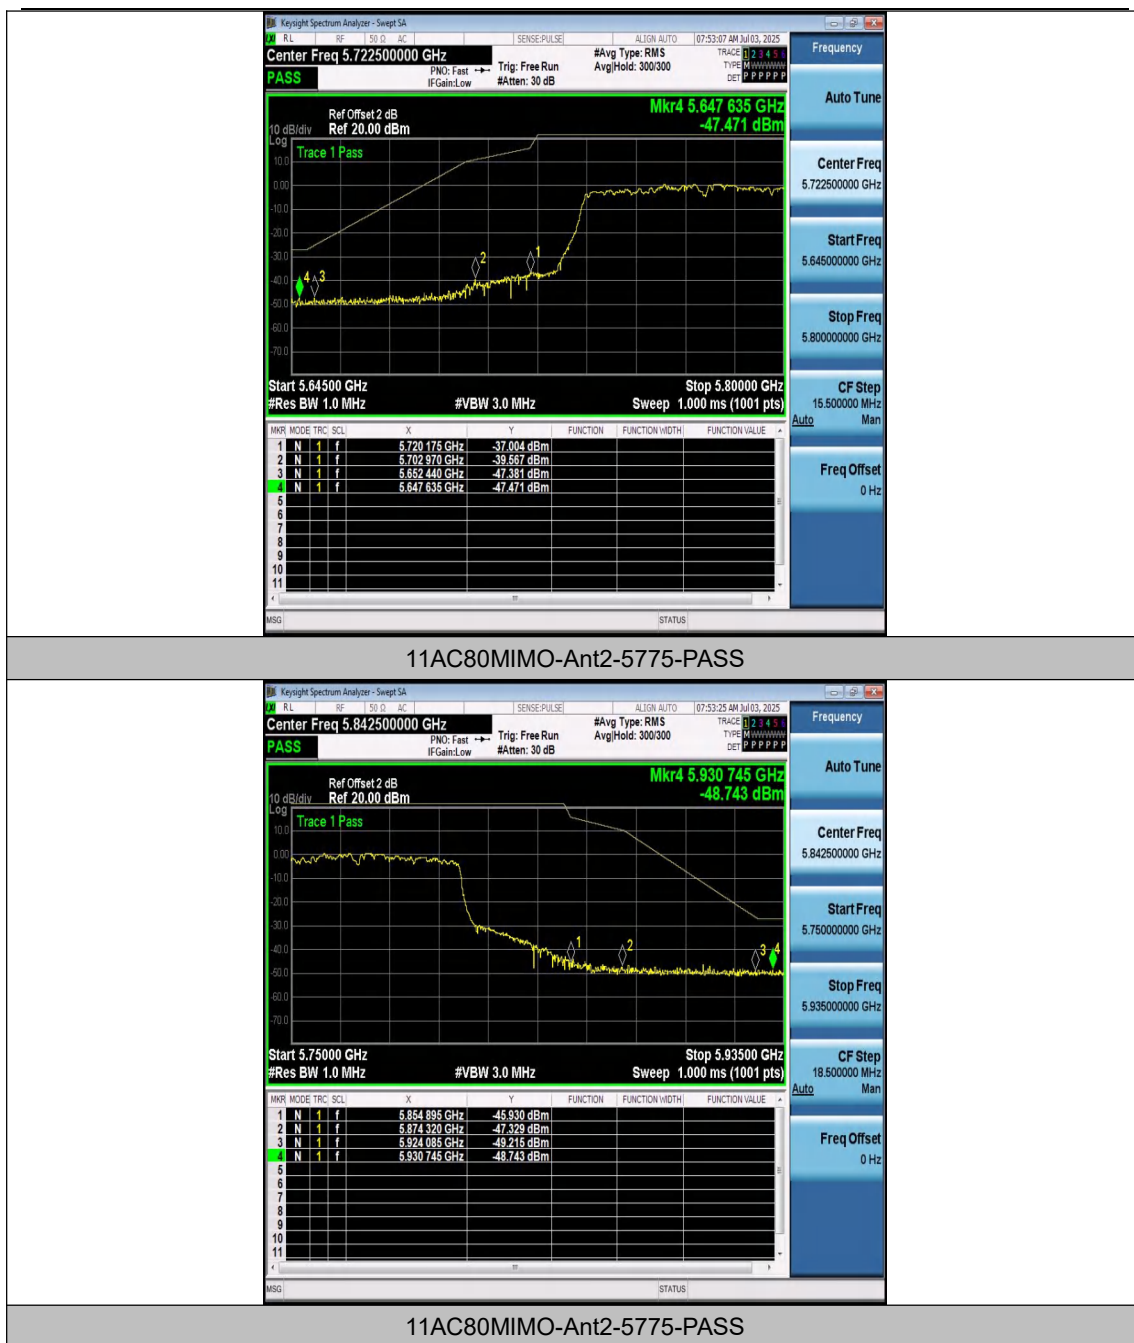

---End---