




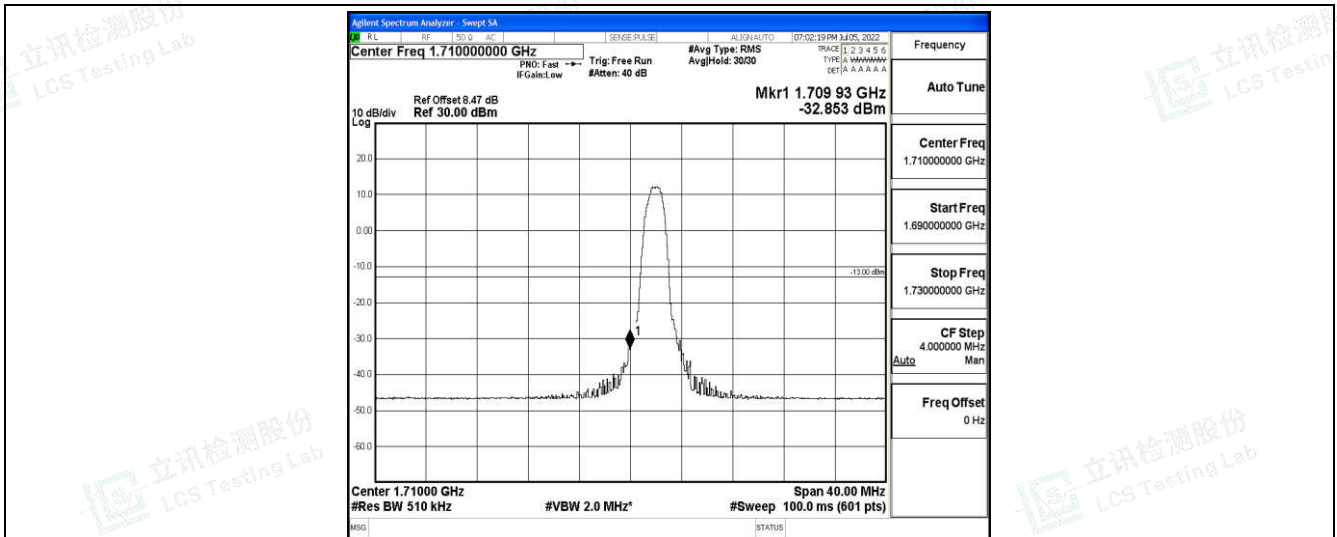

Band4-20MHz-QPSK-20050-6-0-Low--32.85-PASS

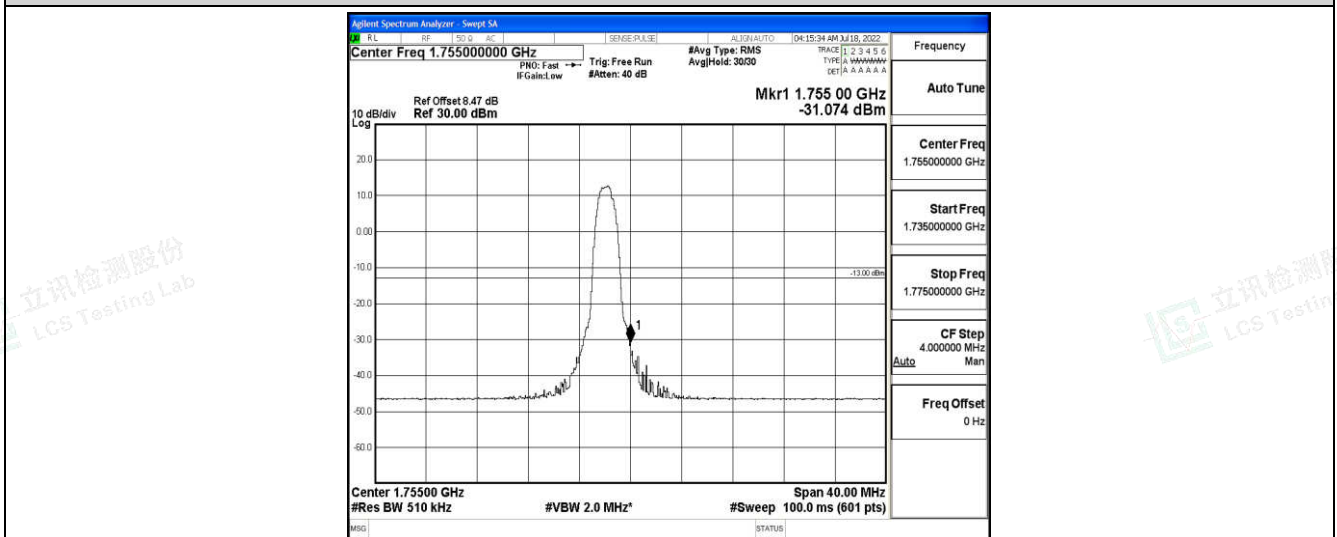


Band4-20MHz-QPSK-20300-6-0-High--31.07-PASS

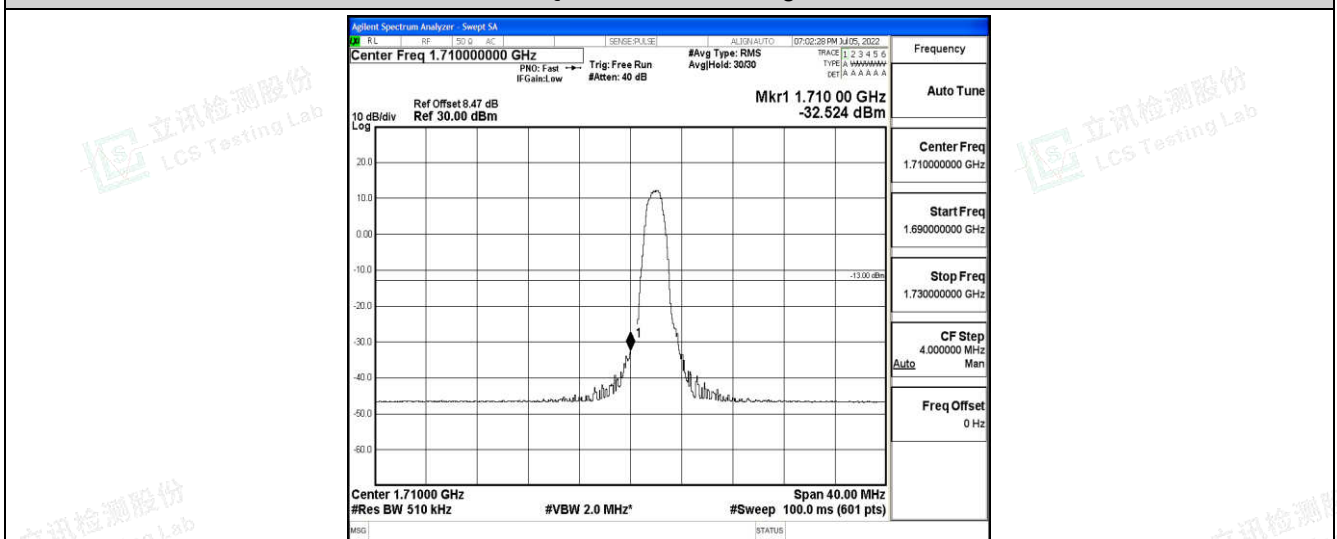

Band4-20MHz-16QAM-20050-6-0-Low--32.52-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

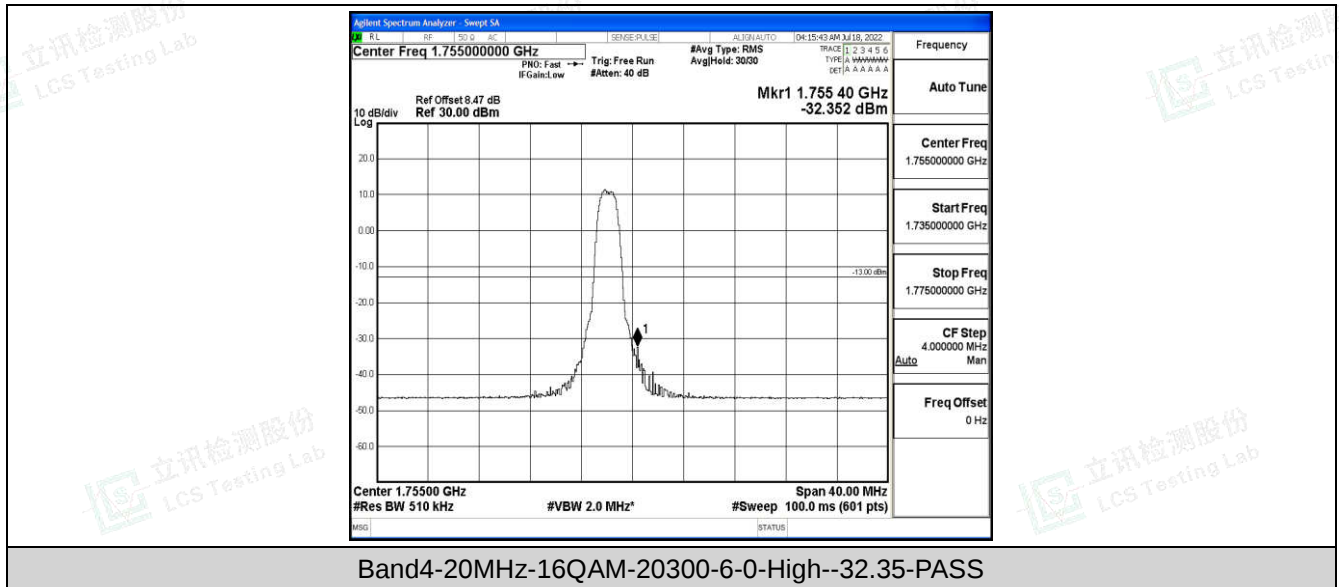



G.5 Conducted Spurious Emission for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Start Freq	Stop Freq	Result (dBm)	Verdict
Band4	1.4MHz	19957	QPSK	1	0	Low	30	1000	-35.53	PASS
Band4	1.4MHz	19957	QPSK	1	0	Low	1000	5000	-39.14	PASS
Band4	1.4MHz	19957	QPSK	1	0	Low	5000	12000	-57.8	PASS
Band4	1.4MHz	19957	QPSK	1	0	Low	12000	26500	-43.06	PASS
Band4	1.4MHz	20175	QPSK	1	0	Low	30	1000	-36.07	PASS
Band4	1.4MHz	20175	QPSK	1	0	Low	1000	5000	-39.68	PASS
Band4	1.4MHz	20175	QPSK	1	0	Low	5000	12000	-57.97	PASS
Band4	1.4MHz	20175	QPSK	1	0	Low	12000	26500	-42.92	PASS
Band4	1.4MHz	20393	QPSK	1	0	High	30	1000	-35.98	PASS
Band4	1.4MHz	20393	QPSK	1	0	High	1000	5000	-39.81	PASS
Band4	1.4MHz	20393	QPSK	1	0	High	5000	12000	-57.98	PASS
Band4	1.4MHz	20393	QPSK	1	0	High	12000	26500	-43.09	PASS
Band4	1.4MHz	19957	16QAM	1	0	Low	30	1000	-36.36	PASS
Band4	1.4MHz	19957	16QAM	1	0	Low	1000	5000	-39.9	PASS
Band4	1.4MHz	19957	16QAM	1	0	Low	5000	12000	-57.89	PASS
Band4	1.4MHz	19957	16QAM	1	0	Low	12000	26500	-42.7	PASS
Band4	1.4MHz	20175	16QAM	1	0	Low	30	1000	-36.07	PASS
Band4	1.4MHz	20175	16QAM	1	0	Low	1000	5000	-40.81	PASS
Band4	1.4MHz	20175	16QAM	1	0	Low	5000	12000	-57.91	PASS
Band4	1.4MHz	20175	16QAM	1	0	Low	12000	26500	-42.93	PASS
Band4	1.4MHz	20393	16QAM	1	0	High	30	1000	-34.81	PASS
Band4	1.4MHz	20393	16QAM	1	0	High	1000	5000	-41.42	PASS
Band4	1.4MHz	20393	16QAM	1	0	High	5000	12000	-57.97	PASS
Band4	1.4MHz	20393	16QAM	1	0	High	12000	26500	-43.11	PASS
Band4	3MHz	19965	QPSK	1	0	Low	30	1000	-36.02	PASS
Band4	3MHz	19965	QPSK	1	0	Low	1000	5000	-38.93	PASS
Band4	3MHz	19965	QPSK	1	0	Low	5000	12000	-57.85	PASS
Band4	3MHz	19965	QPSK	1	0	Low	12000	26500	-43.04	PASS
Band4	3MHz	20175	QPSK	1	0	Low	30	1000	-35.85	PASS
Band4	3MHz	20175	QPSK	1	0	Low	1000	5000	-39.97	PASS
Band4	3MHz	20175	QPSK	1	0	Low	5000	12000	-57.63	PASS
Band4	3MHz	20175	QPSK	1	0	Low	12000	26500	-43.18	PASS
Band4	3MHz	20385	QPSK	1	0	High	30	1000	-35.74	PASS





Band4	3MHz	20385	QPSK	1	0	High	1000	5000	-39.49	PASS
Band4	3MHz	20385	QPSK	1	0	High	5000	12000	-57.78	PASS
Band4	3MHz	20385	QPSK	1	0	High	12000	26500	-43.16	PASS
Band4	3MHz	19965	16QAM	1	0	Low	30	1000	-35.74	PASS
Band4	3MHz	19965	16QAM	1	0	Low	1000	5000	-39.65	PASS
Band4	3MHz	19965	16QAM	1	0	Low	5000	12000	-57.95	PASS
Band4	3MHz	19965	16QAM	1	0	Low	12000	26500	-43.02	PASS
Band4	3MHz	20175	16QAM	1	0	Low	30	1000	-35.65	PASS
Band4	3MHz	20175	16QAM	1	0	Low	1000	5000	-40.55	PASS
Band4	3MHz	20175	16QAM	1	0	Low	5000	12000	-57.97	PASS
Band4	3MHz	20175	16QAM	1	0	Low	12000	26500	-43.23	PASS
Band4	3MHz	20385	16QAM	1	0	High	30	1000	-36.25	PASS
Band4	3MHz	20385	16QAM	1	0	High	1000	5000	-40.39	PASS
Band4	3MHz	20385	16QAM	1	0	High	5000	12000	-57.95	PASS
Band4	3MHz	20385	16QAM	1	0	High	12000	26500	-42.68	PASS
Band4	5MHz	19975	QPSK	1	0	Low	30	1000	-35.5	PASS
Band4	5MHz	19975	QPSK	1	0	Low	1000	5000	-39.13	PASS
Band4	5MHz	19975	QPSK	1	0	Low	5000	12000	-57.96	PASS
Band4	5MHz	19975	QPSK	1	0	Low	12000	26500	-43.1	PASS
Band4	5MHz	20175	QPSK	1	0	Low	30	1000	-34.29	PASS
Band4	5MHz	20175	QPSK	1	0	Low	1000	5000	-39.7	PASS
Band4	5MHz	20175	QPSK	1	0	Low	5000	12000	-57.84	PASS
Band4	5MHz	20175	QPSK	1	0	Low	12000	26500	-43.1	PASS
Band4	5MHz	20375	QPSK	1	0	High	30	1000	-35.77	PASS
Band4	5MHz	20375	QPSK	1	0	High	1000	5000	-39.48	PASS
Band4	5MHz	20375	QPSK	1	0	High	5000	12000	-57.87	PASS
Band4	5MHz	20375	QPSK	1	0	High	12000	26500	-43.19	PASS
Band4	5MHz	19975	16QAM	1	0	Low	30	1000	-35.21	PASS
Band4	5MHz	19975	16QAM	1	0	Low	1000	5000	-39.39	PASS
Band4	5MHz	19975	16QAM	1	0	Low	5000	12000	-57.97	PASS
Band4	5MHz	19975	16QAM	1	0	Low	12000	26500	-43.27	PASS
Band4	5MHz	20175	16QAM	1	0	Low	30	1000	-35.79	PASS
Band4	5MHz	20175	16QAM	1	0	Low	1000	5000	-39.92	PASS
Band4	5MHz	20175	16QAM	1	0	Low	5000	12000	-57.94	PASS
Band4	5MHz	20175	16QAM	1	0	Low	12000	26500	-43.12	PASS
Band4	5MHz	20375	16QAM	1	0	High	30	1000	-34.88	PASS
Band4	5MHz	20375	16QAM	1	0	High	1000	5000	-39.85	PASS
Band4	5MHz	20375	16QAM	1	0	High	5000	12000	-57.98	PASS
Band4	5MHz	20375	16QAM	1	0	High	12000	26500	-43.01	PASS
Band4	10MHz	20000	QPSK	1	0	Low	30	1000	-35.75	PASS





Band4	10MHz	20000	QPSK	1	0	Low	1000	5000	-39.06	PASS
Band4	10MHz	20000	QPSK	1	0	Low	5000	12000	-58	PASS
Band4	10MHz	20000	QPSK	1	0	Low	12000	26500	-43.18	PASS
Band4	10MHz	20175	QPSK	1	0	Low	30	1000	-35.99	PASS
Band4	10MHz	20175	QPSK	1	0	Low	1000	5000	-40.18	PASS
Band4	10MHz	20175	QPSK	1	0	Low	5000	12000	-58.04	PASS
Band4	10MHz	20175	QPSK	1	0	Low	12000	26500	-43.24	PASS
Band4	10MHz	20350	QPSK	1	0	High	30	1000	-36	PASS
Band4	10MHz	20350	QPSK	1	0	High	1000	5000	-40.39	PASS
Band4	10MHz	20350	QPSK	1	0	High	5000	12000	-58.08	PASS
Band4	10MHz	20350	QPSK	1	0	High	12000	26500	-43.24	PASS
Band4	10MHz	20000	16QAM	1	0	Low	30	1000	-34.61	PASS
Band4	10MHz	20000	16QAM	1	0	Low	1000	5000	-39.57	PASS
Band4	10MHz	20000	16QAM	1	0	Low	5000	12000	-57.85	PASS
Band4	10MHz	20000	16QAM	1	0	Low	12000	26500	-42.93	PASS
Band4	10MHz	20175	16QAM	1	0	Low	30	1000	-36.11	PASS
Band4	10MHz	20175	16QAM	1	0	Low	1000	5000	-39.72	PASS
Band4	10MHz	20175	16QAM	1	0	Low	5000	12000	-58.01	PASS
Band4	10MHz	20175	16QAM	1	0	Low	12000	26500	-43.17	PASS
Band4	10MHz	20350	16QAM	1	0	High	30	1000	-35.9	PASS
Band4	10MHz	20350	16QAM	1	0	High	1000	5000	-39.66	PASS
Band4	10MHz	20350	16QAM	1	0	High	5000	12000	-57.82	PASS
Band4	10MHz	20350	16QAM	1	0	High	12000	26500	-43.18	PASS
Band4	15MHz	20025	QPSK	1	0	Low	30	1000	-35.45	PASS
Band4	15MHz	20025	QPSK	1	0	Low	1000	5000	-39.41	PASS
Band4	15MHz	20025	QPSK	1	0	Low	5000	12000	-57.97	PASS
Band4	15MHz	20025	QPSK	1	0	Low	12000	26500	-42.88	PASS
Band4	15MHz	20175	QPSK	1	0	Low	30	1000	-35.32	PASS
Band4	15MHz	20175	QPSK	1	0	Low	1000	5000	-39.72	PASS
Band4	15MHz	20175	QPSK	1	0	Low	5000	12000	-57.91	PASS
Band4	15MHz	20175	QPSK	1	0	Low	12000	26500	-43.18	PASS
Band4	15MHz	20325	QPSK	1	0	High	30	1000	-35.7	PASS
Band4	15MHz	20325	QPSK	1	0	High	1000	5000	-39.8	PASS
Band4	15MHz	20325	QPSK	1	0	High	5000	12000	-57.92	PASS
Band4	15MHz	20325	QPSK	1	0	High	12000	26500	-43.14	PASS
Band4	15MHz	20025	16QAM	1	0	Low	30	1000	-35.84	PASS
Band4	15MHz	20025	16QAM	1	0	Low	1000	5000	-40.3	PASS
Band4	15MHz	20025	16QAM	1	0	Low	5000	12000	-57.8	PASS
Band4	15MHz	20025	16QAM	1	0	Low	12000	26500	-43.27	PASS
Band4	15MHz	20175	16QAM	1	0	Low	30	1000	-36.34	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band4	15MHz	20175	16QAM	1	0	Low	1000	5000	-39.39	PASS
Band4	15MHz	20175	16QAM	1	0	Low	5000	12000	-57.96	PASS
Band4	15MHz	20175	16QAM	1	0	Low	12000	26500	-43.27	PASS
Band4	15MHz	20325	16QAM	1	0	High	30	1000	-35.37	PASS
Band4	15MHz	20325	16QAM	1	0	High	1000	5000	-39.97	PASS
Band4	15MHz	20325	16QAM	1	0	High	5000	12000	-57.94	PASS
Band4	15MHz	20325	16QAM	1	0	High	12000	26500	-43.22	PASS
Band4	20MHz	20050	QPSK	1	0	Low	30	1000	-35.98	PASS
Band4	20MHz	20050	QPSK	1	0	Low	1000	5000	-39.25	PASS
Band4	20MHz	20050	QPSK	1	0	Low	5000	12000	-58.07	PASS
Band4	20MHz	20050	QPSK	1	0	Low	12000	26500	-43.12	PASS
Band4	20MHz	20175	QPSK	1	0	Low	30	1000	-35.53	PASS
Band4	20MHz	20175	QPSK	1	0	Low	1000	5000	-39.71	PASS
Band4	20MHz	20175	QPSK	1	0	Low	5000	12000	-58.06	PASS
Band4	20MHz	20175	QPSK	1	0	Low	12000	26500	-43.21	PASS
Band4	20MHz	20300	QPSK	1	0	High	30	1000	-36.29	PASS
Band4	20MHz	20300	QPSK	1	0	High	1000	5000	-42.03	PASS
Band4	20MHz	20300	QPSK	1	0	High	5000	12000	-58.01	PASS
Band4	20MHz	20300	QPSK	1	0	High	12000	26500	-43.14	PASS
Band4	20MHz	20050	16QAM	1	0	Low	30	1000	-36.46	PASS
Band4	20MHz	20050	16QAM	1	0	Low	1000	5000	-39.89	PASS
Band4	20MHz	20050	16QAM	1	0	Low	5000	12000	-57.98	PASS
Band4	20MHz	20050	16QAM	1	0	Low	12000	26500	-43.22	PASS
Band4	20MHz	20175	16QAM	1	0	Low	30	1000	-35.94	PASS
Band4	20MHz	20175	16QAM	1	0	Low	1000	5000	-39.5	PASS
Band4	20MHz	20175	16QAM	1	0	Low	5000	12000	-57.73	PASS
Band4	20MHz	20175	16QAM	1	0	Low	12000	26500	-43.29	PASS
Band4	20MHz	20300	16QAM	1	0	High	30	1000	-35.96	PASS
Band4	20MHz	20300	16QAM	1	0	High	1000	5000	-39.64	PASS
Band4	20MHz	20300	16QAM	1	0	High	5000	12000	-57.97	PASS
Band4	20MHz	20300	16QAM	1	0	High	12000	26500	-43.17	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Test Graphs

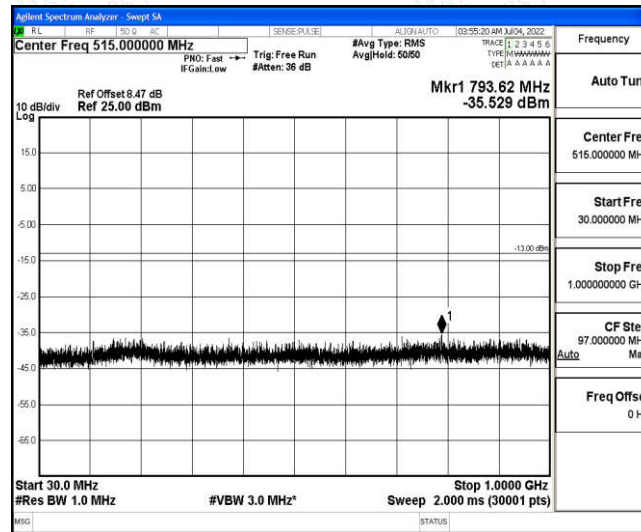


Band4-1.4MHz-QPSK-19957-1-0-Low-30-1000--35.53-PASS

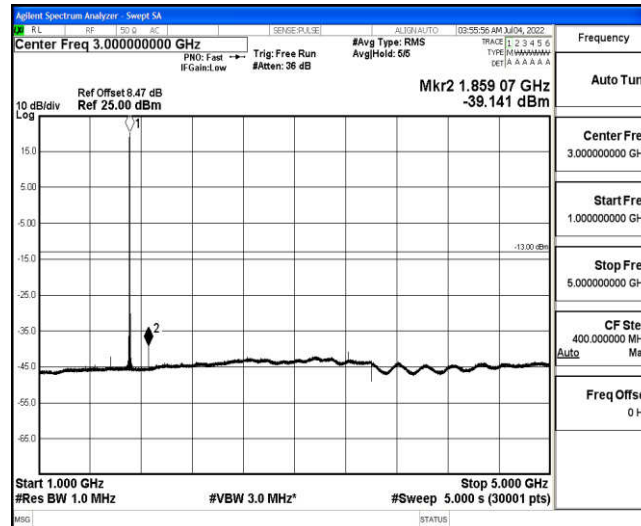


Band4-1.4MHz-QPSK-19957-1-0-Low-1000-5000--39.14-PASS




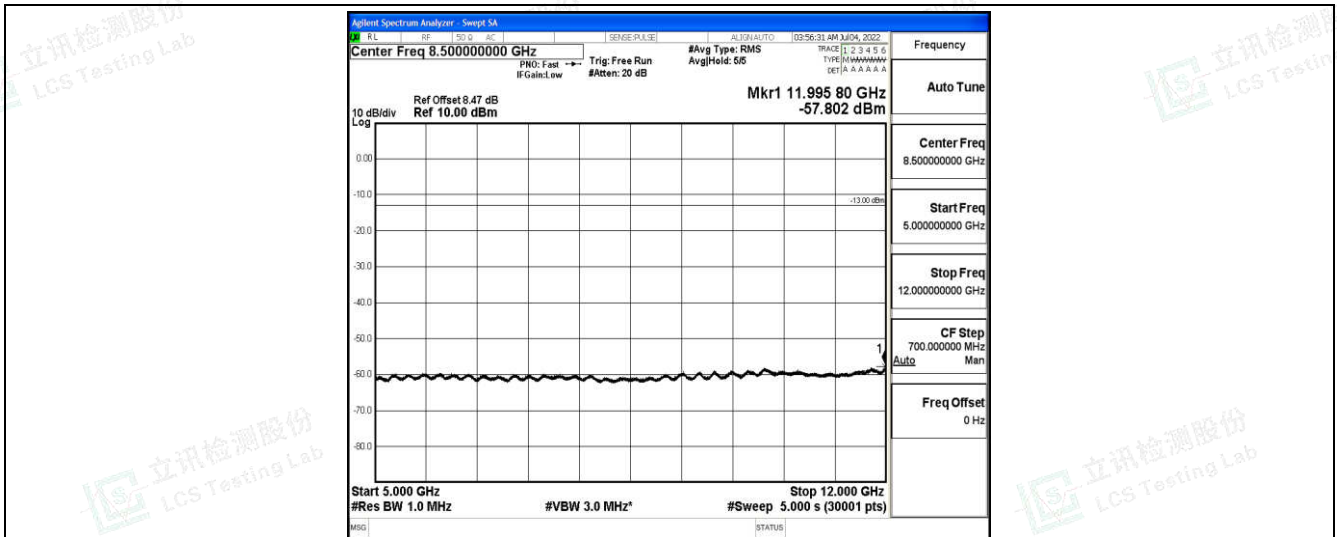

Band4-1.4MHz-QPSK-19957-1-0-Low-5000-12000--57.8-PASS

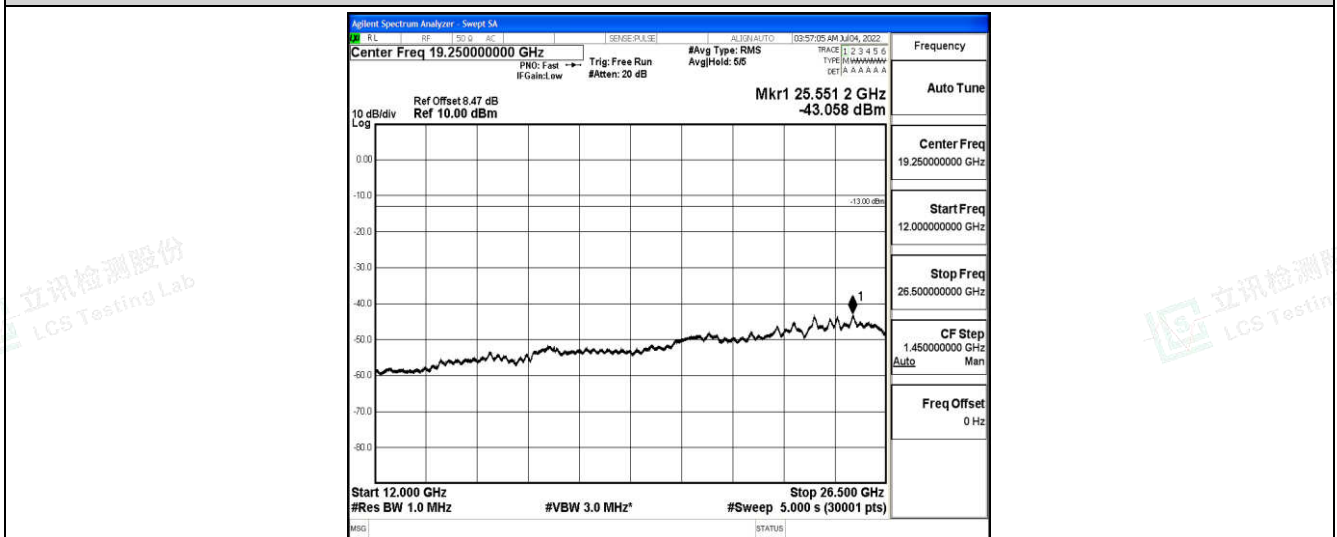


Band4-1.4MHz-QPSK-19957-1-0-Low-12000-26500--43.06-PASS

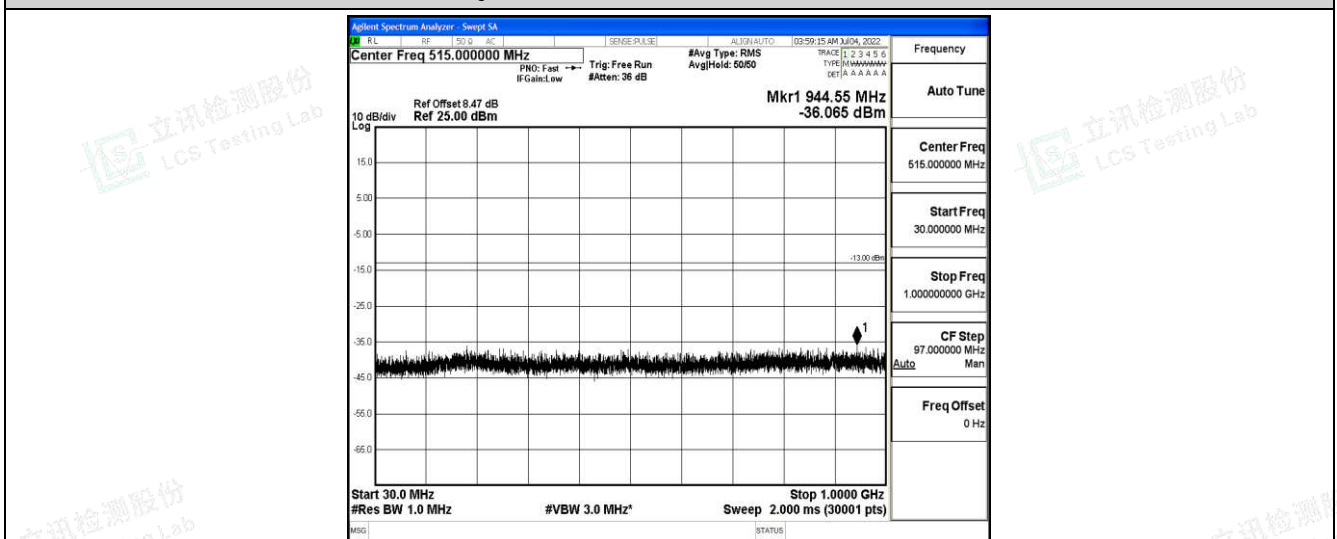


Band4-1.4MHz-QPSK-20175-1-0-Low-30-1000--36.07-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

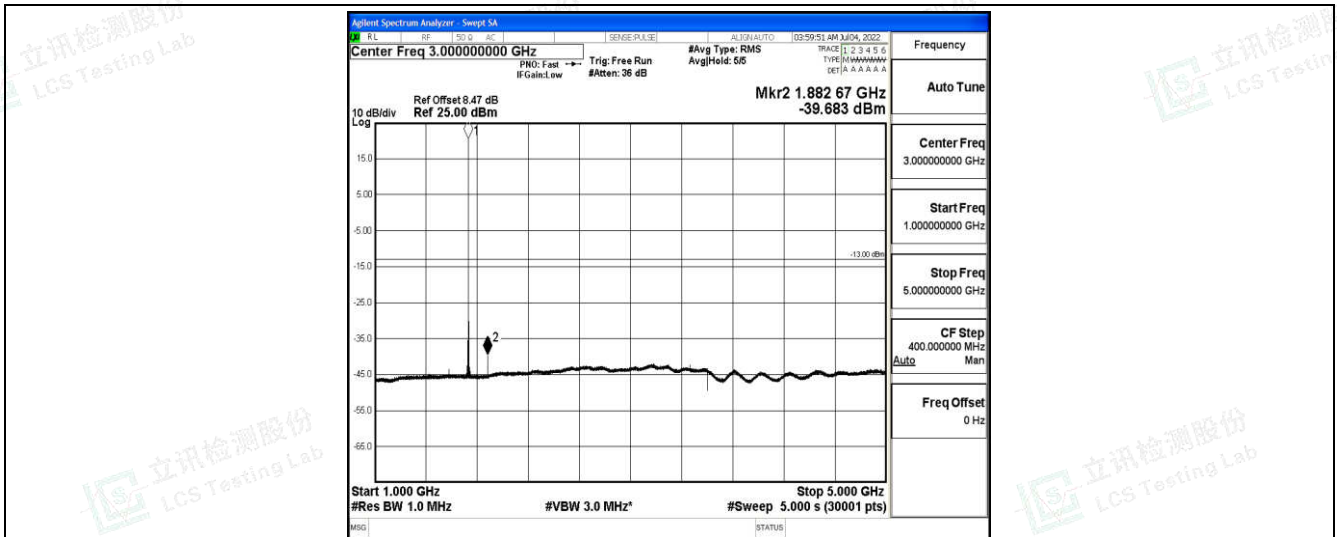

Band4-1.4MHz-QPSK-20175-1-0-Low-1000-5000--39.68-PASS

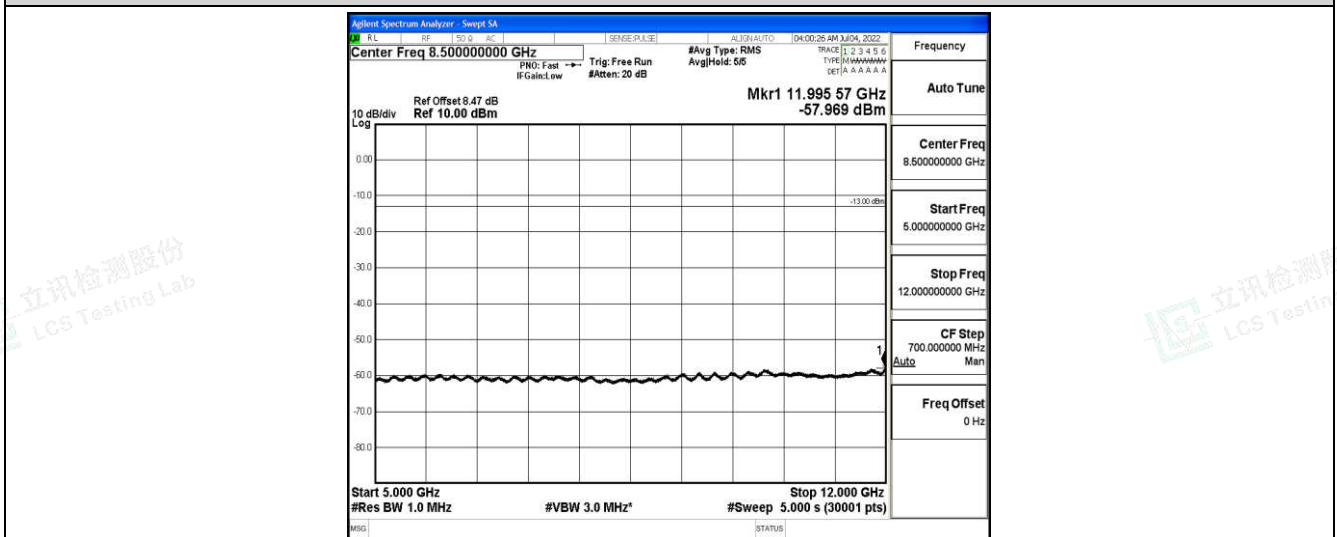


Band4-1.4MHz-QPSK-20175-1-0-Low-5000-12000--57.97-PASS

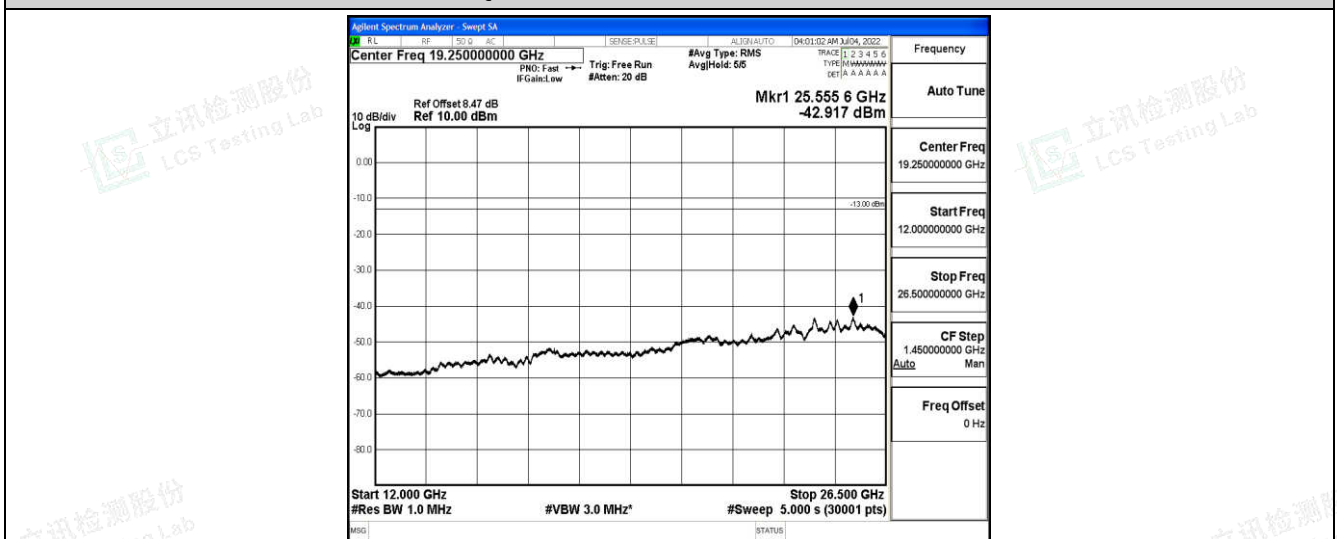


Band4-1.4MHz-QPSK-20175-1-0-Low-12000-26500--42.92-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

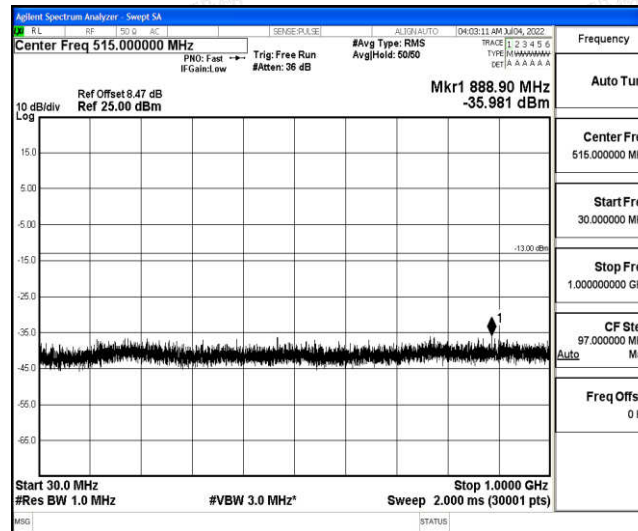

Band4-1.4MHz-QPSK-20393-1-0-High-30-1000--35.98-PASS

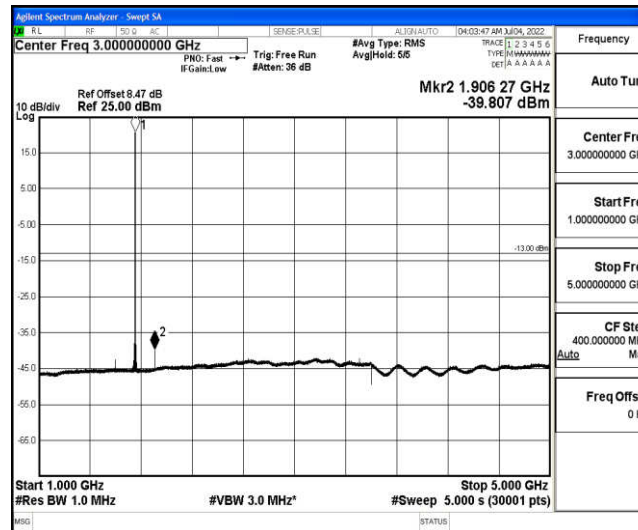


Band4-1.4MHz-QPSK-20393-1-0-High-1000-5000--39.81-PASS

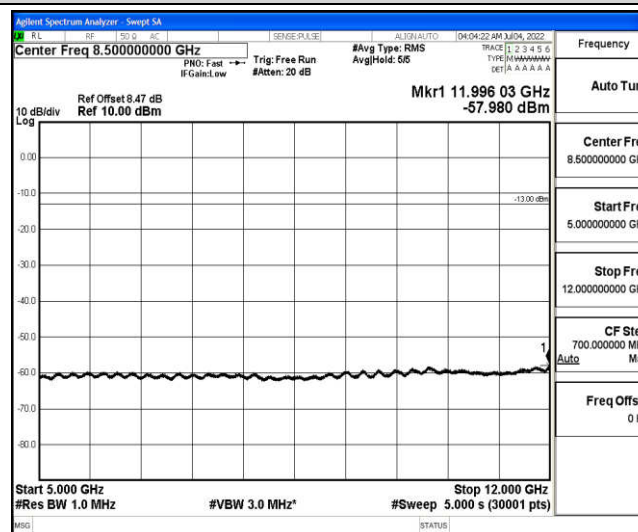


Band4-1.4MHz-QPSK-20393-1-0-High-5000-12000--57.98-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

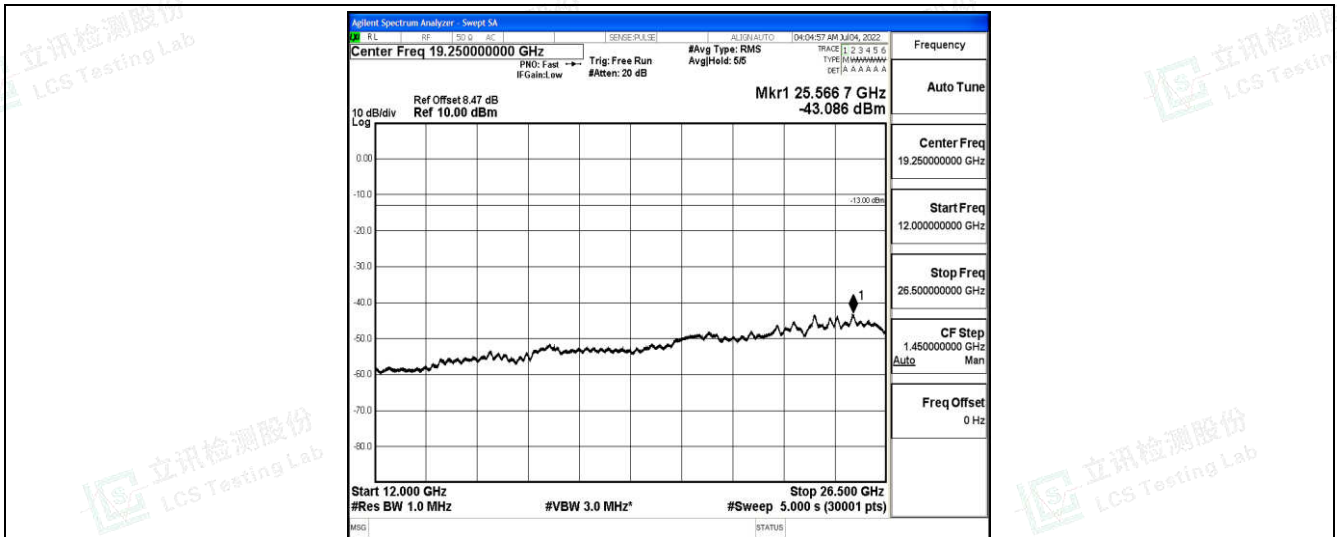

Band4-1.4MHz-QPSK-20393-1-0-High-12000-26500--43.09-PASS

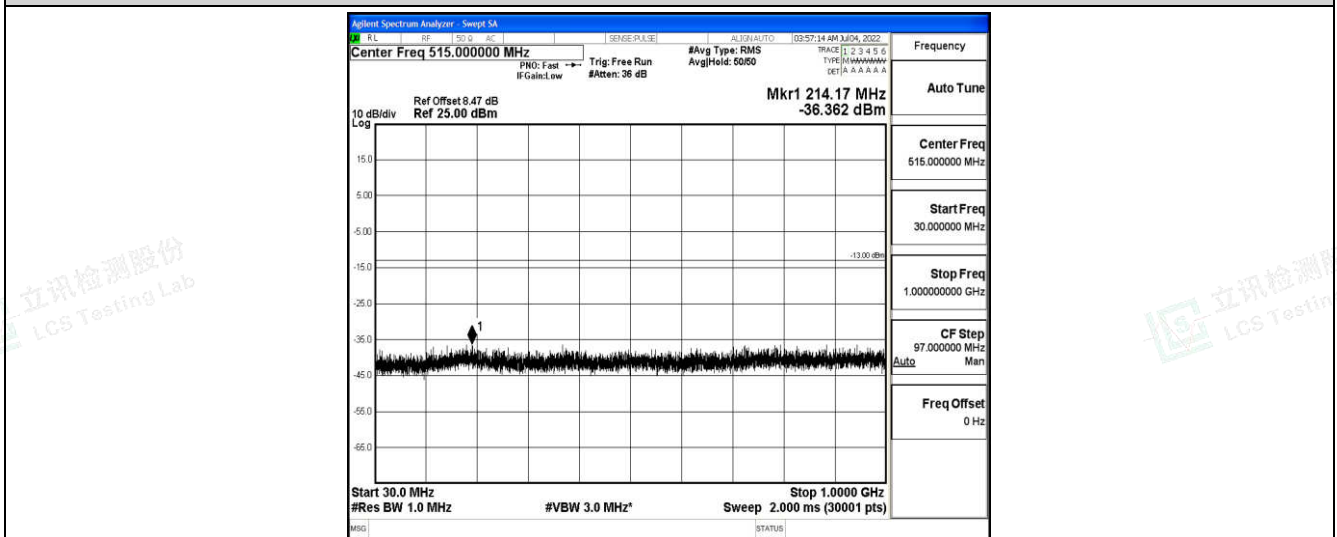


Band4-1.4MHz-16QAM-19957-1-0-Low-30-1000--36.36-PASS

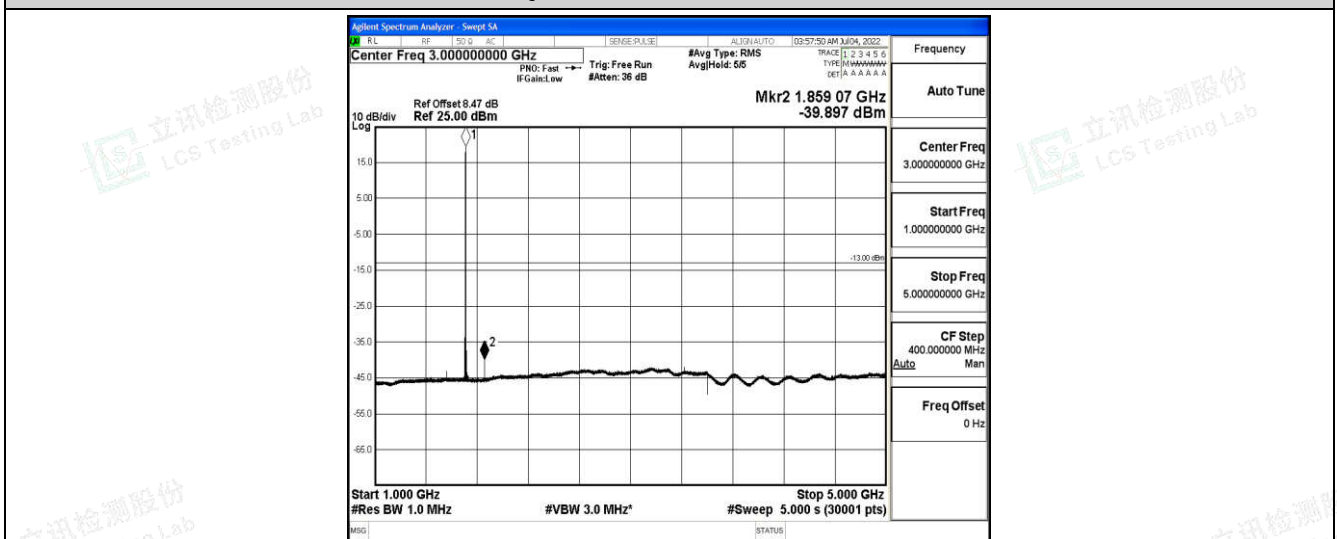


Band4-1.4MHz-16QAM-19957-1-0-Low-1000-5000--39.9-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

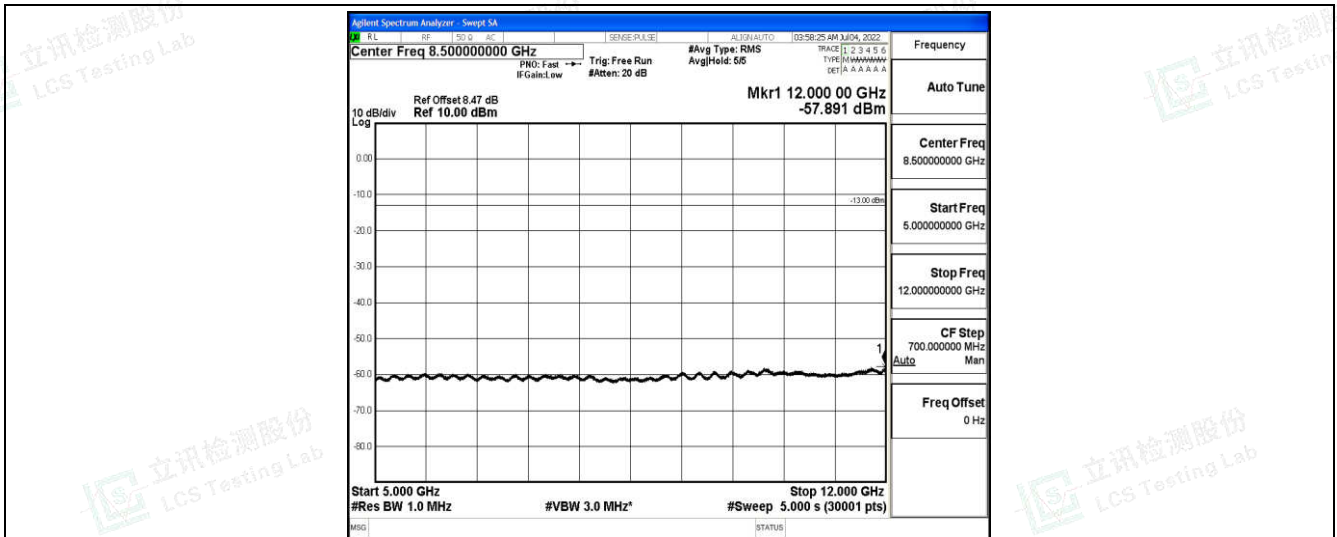

Band4-1.4MHz-16QAM-19957-1-0-Low-5000-12000--57.89-PASS

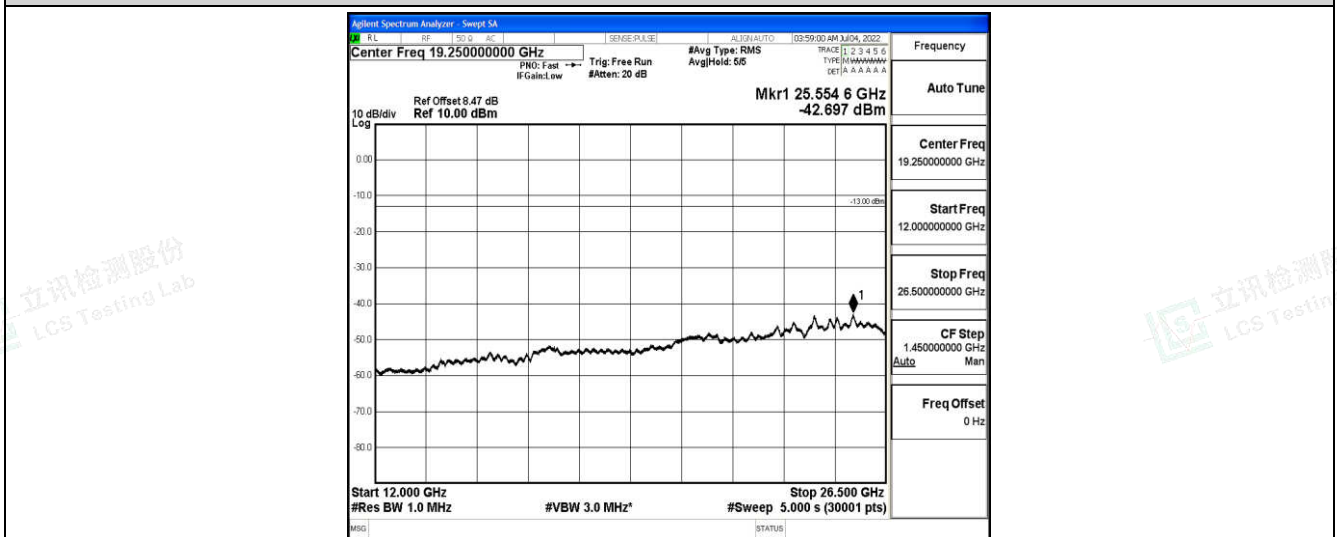


Band4-1.4MHz-16QAM-19957-1-0-Low-12000-26500--42.7-PASS

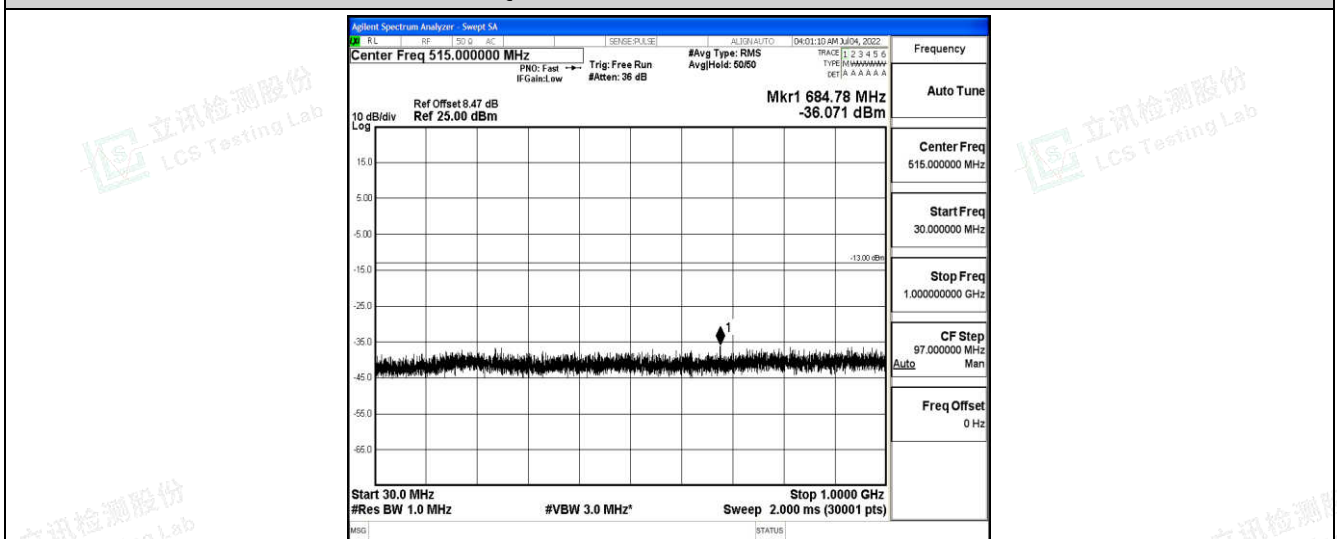


Band4-1.4MHz-16QAM-20175-1-0-Low-30-1000--36.07-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

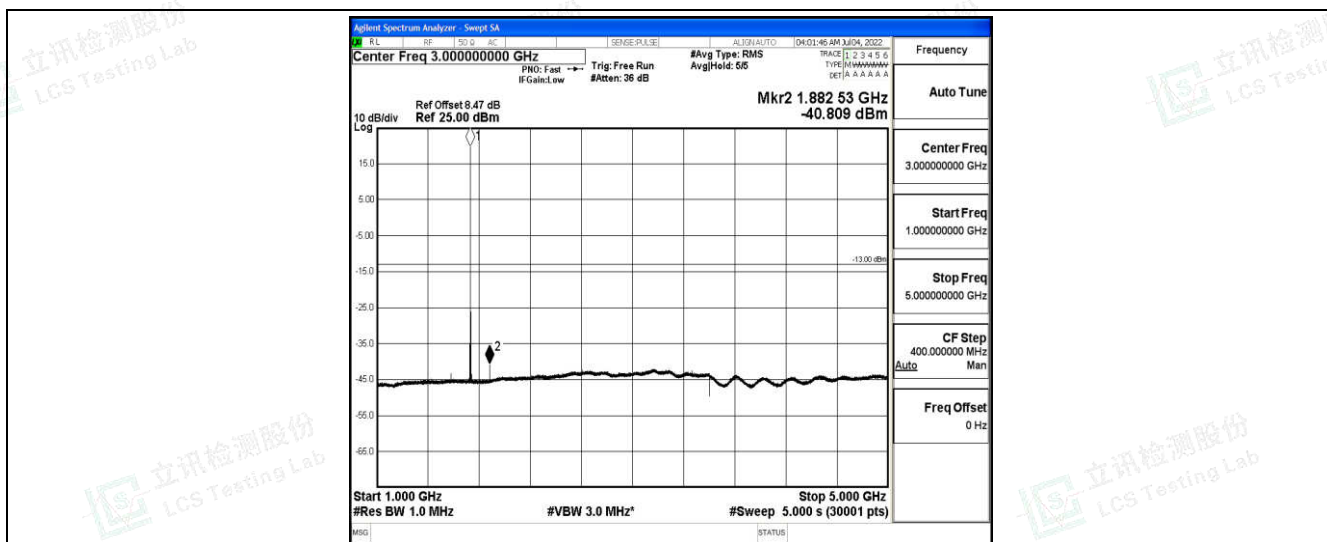

Band4-1.4MHz-16QAM-20175-1-0-Low-1000-5000--40.81-PASS

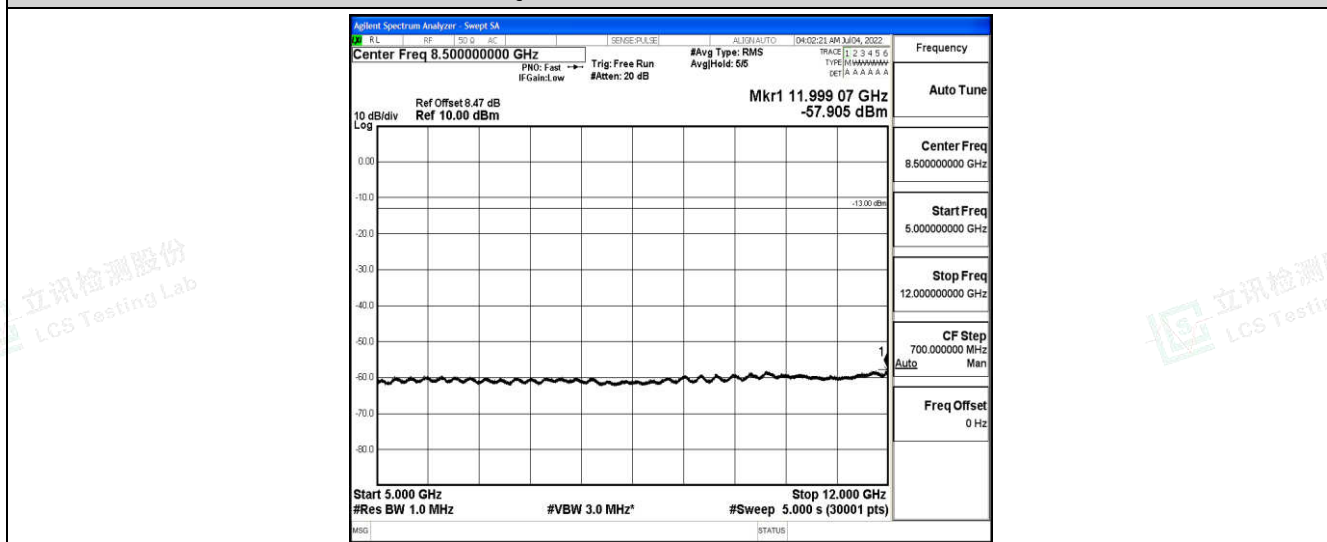


Band4-1.4MHz-16QAM-20175-1-0-Low-5000-12000--57.91-PASS

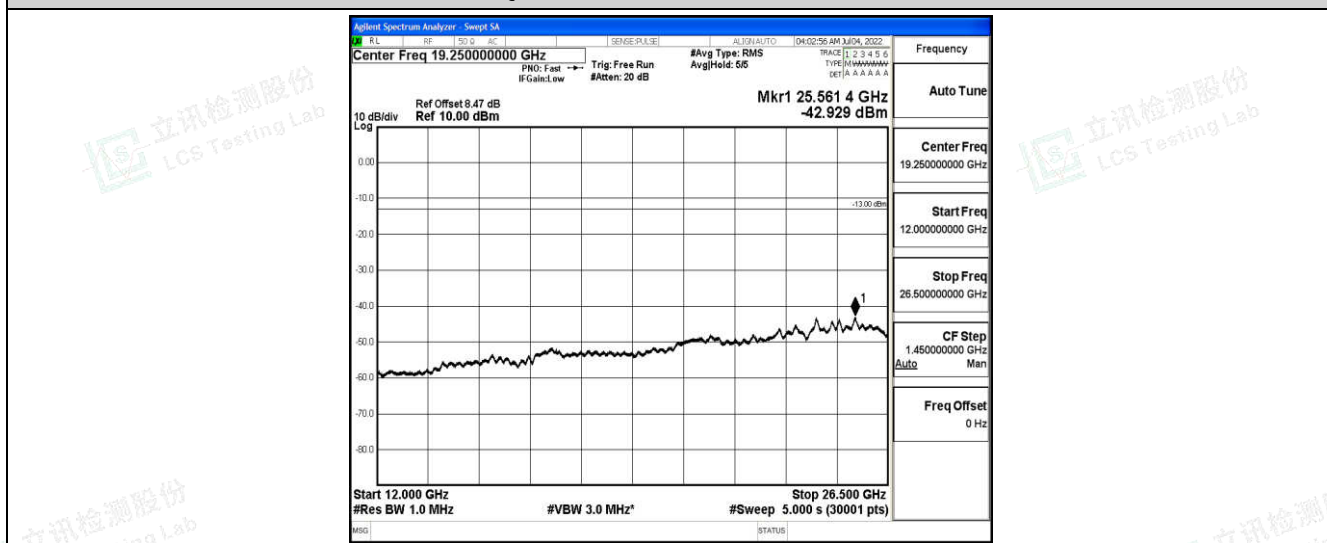


Band4-1.4MHz-16QAM-20175-1-0-Low-12000-26500--42.93-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

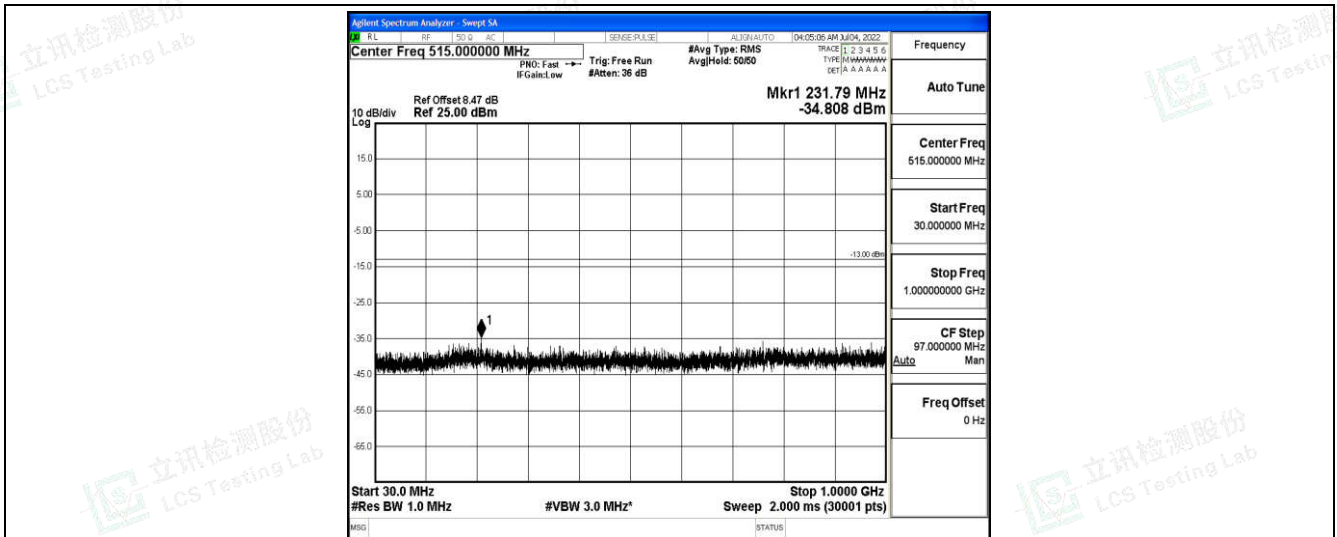

Band4-1.4MHz-16QAM-20393-1-0-High-30-1000--34.81-PASS

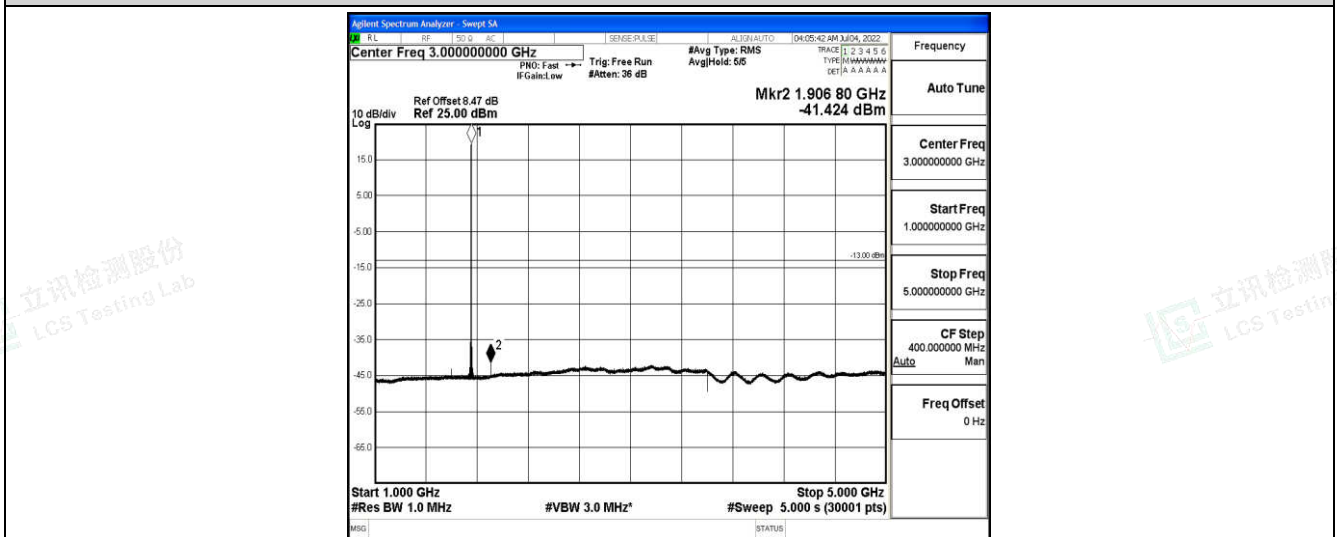


Band4-1.4MHz-16QAM-20393-1-0-High-1000-5000--41.42-PASS

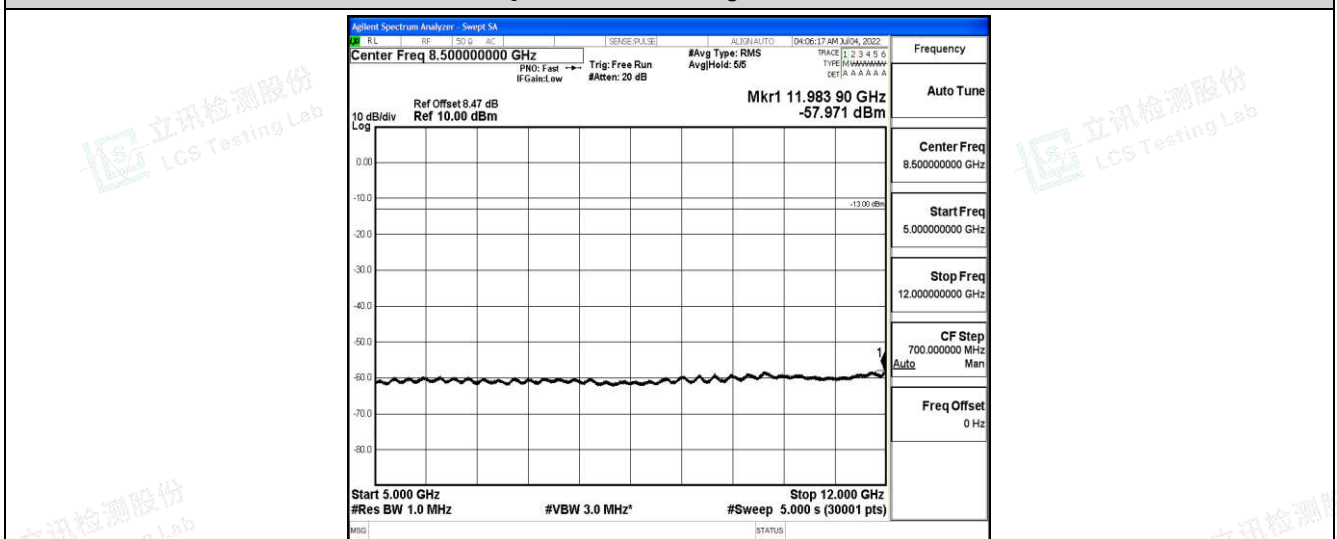


Band4-1.4MHz-16QAM-20393-1-0-High-5000-12000--57.97-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

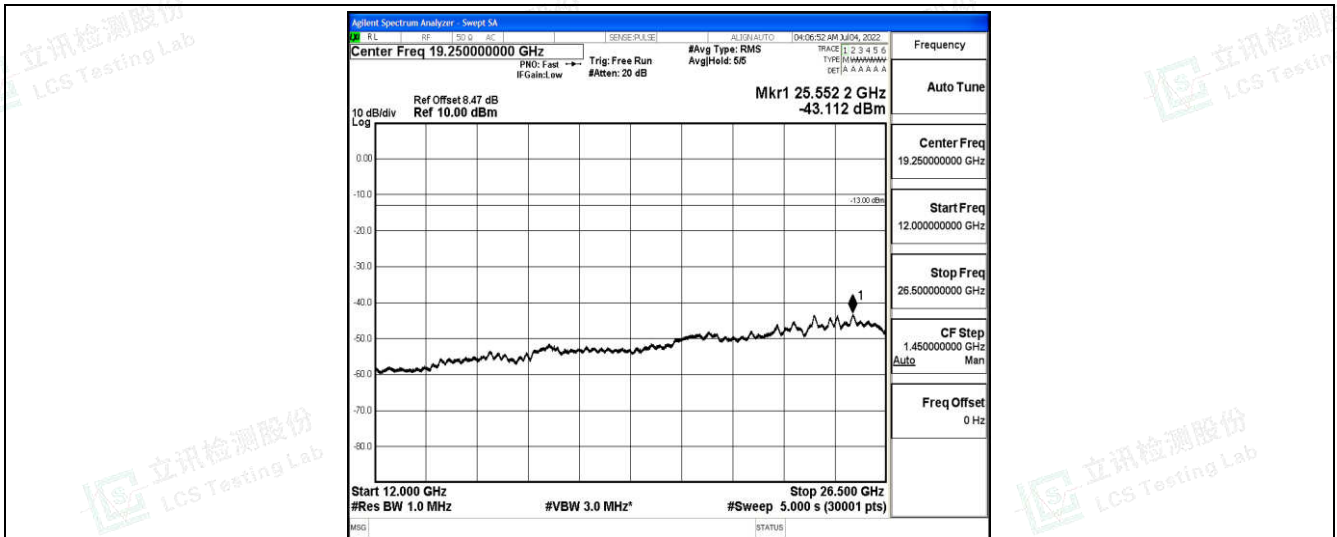

Band4-1.4MHz-16QAM-20393-1-0-High-12000-26500--43.11-PASS

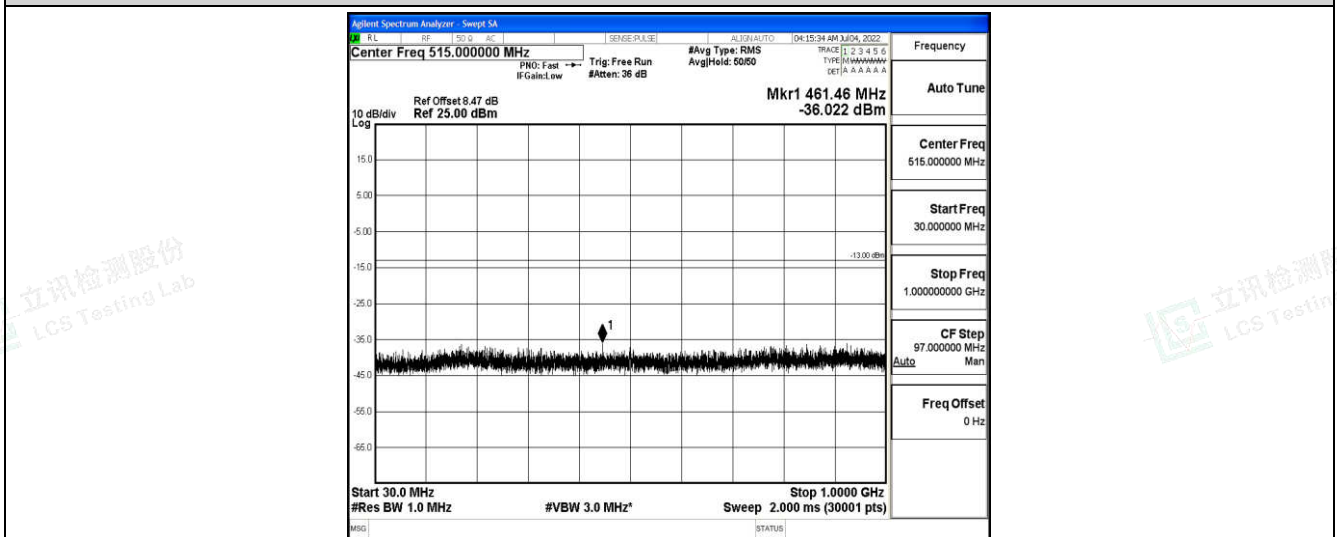


Band4-3MHz-QPSK-19965-1-0-Low-30-1000--36.02-PASS

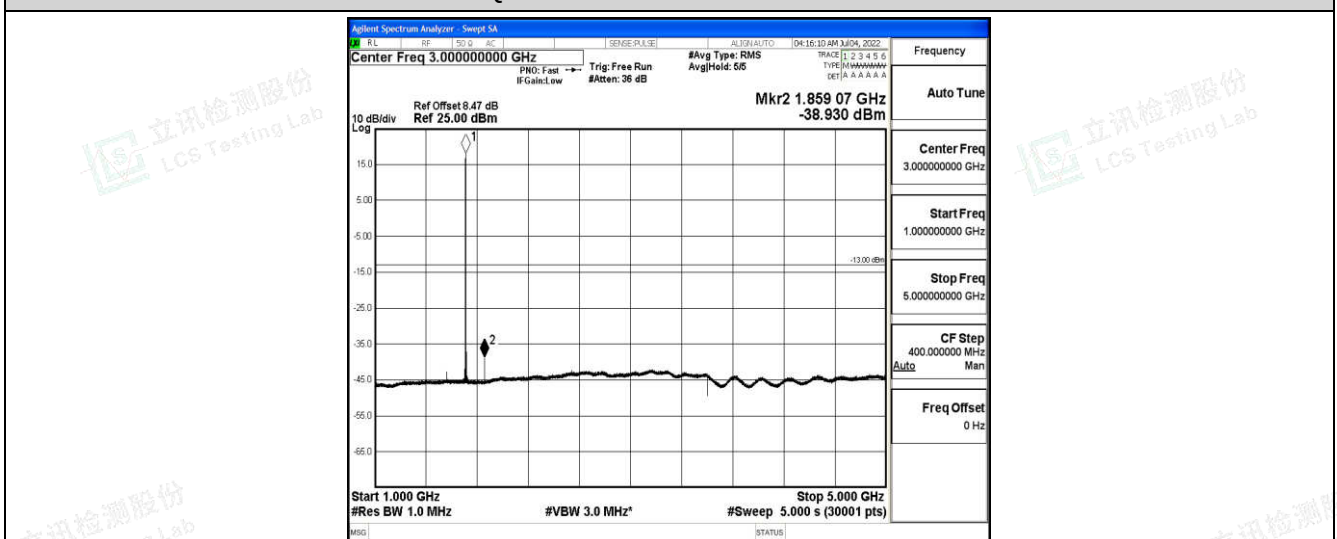


Band4-3MHz-QPSK-19965-1-0-Low-1000-5000--38.93-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

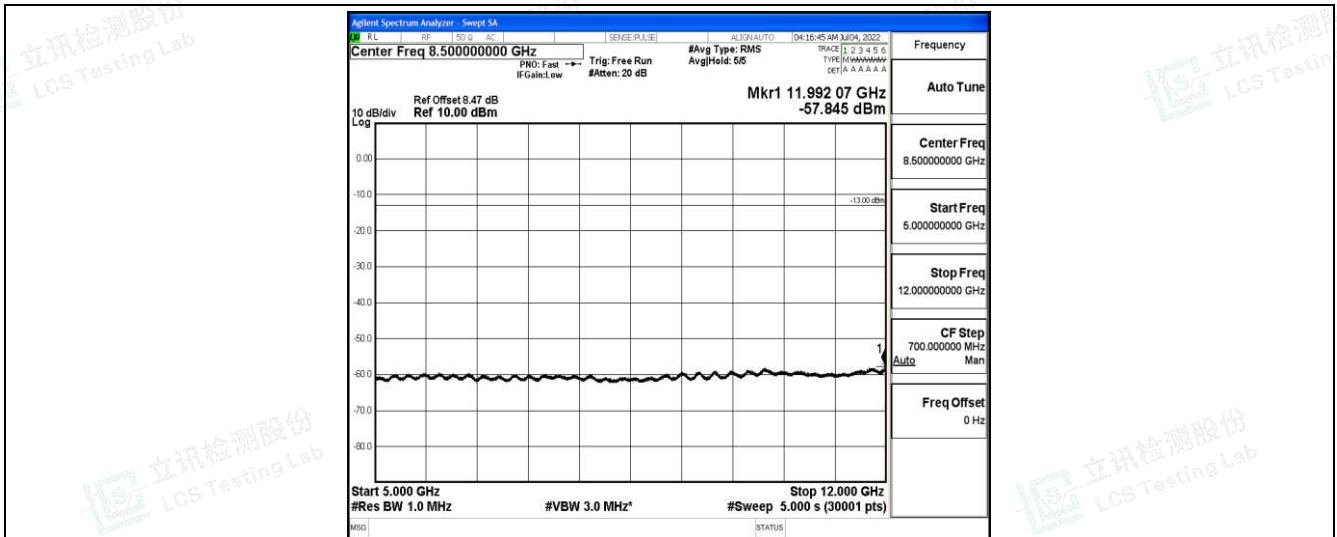

Band4-3MHz-QPSK-19965-1-0-Low-5000-12000--57.85-PASS

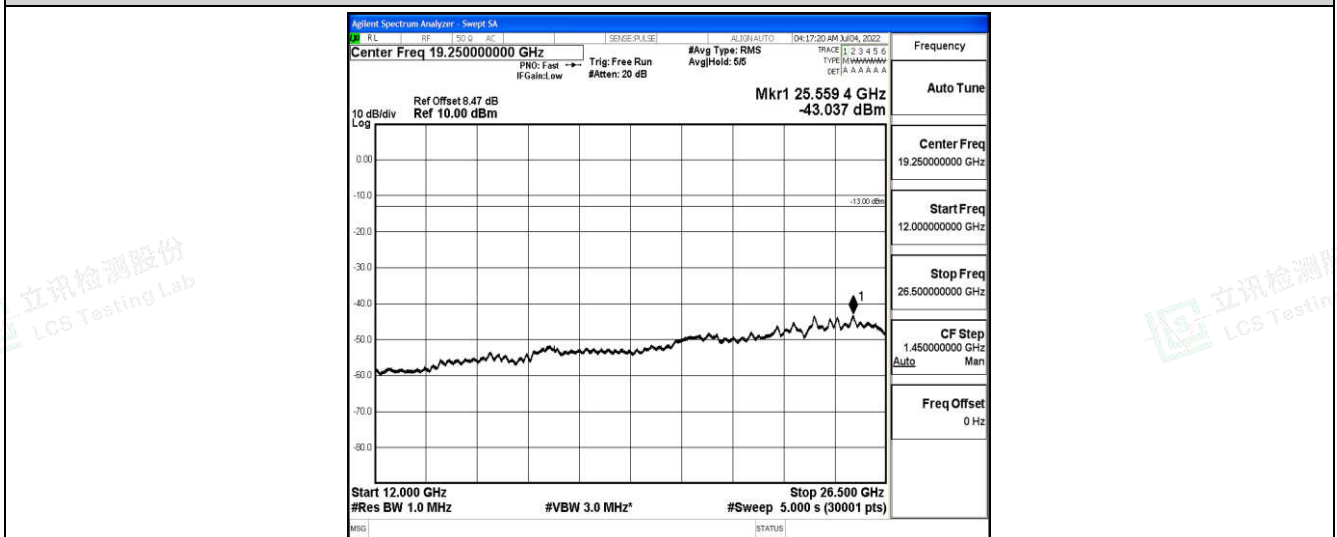


Band4-3MHz-QPSK-19965-1-0-Low-12000-26500--43.04-PASS

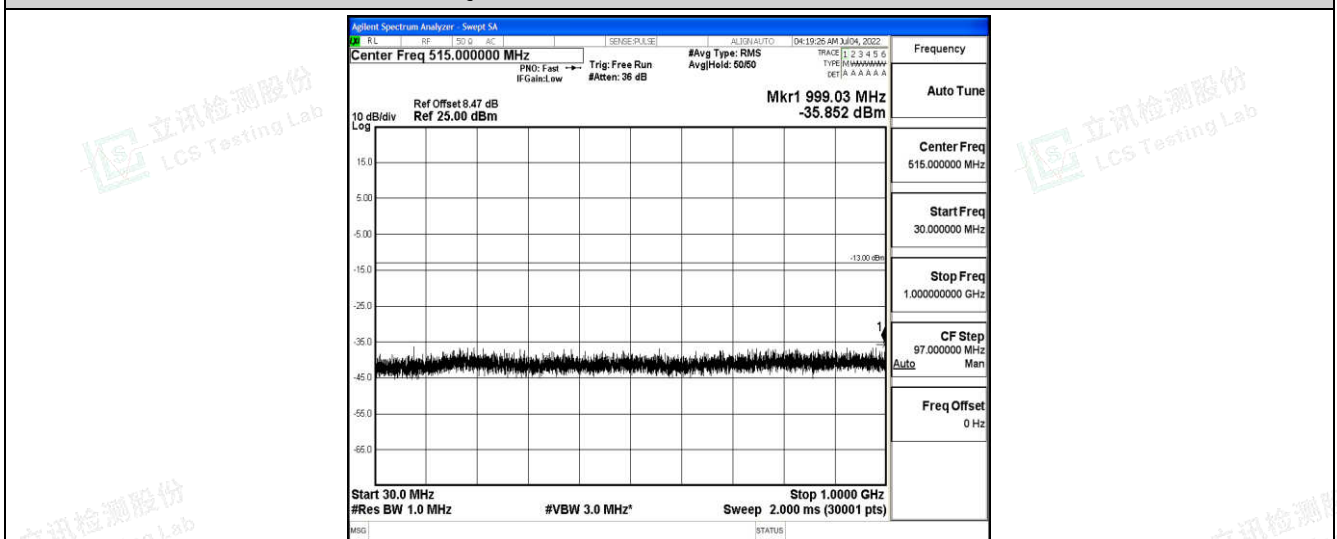


Band4-3MHz-QPSK-20175-1-0-Low-30-1000--35.85-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

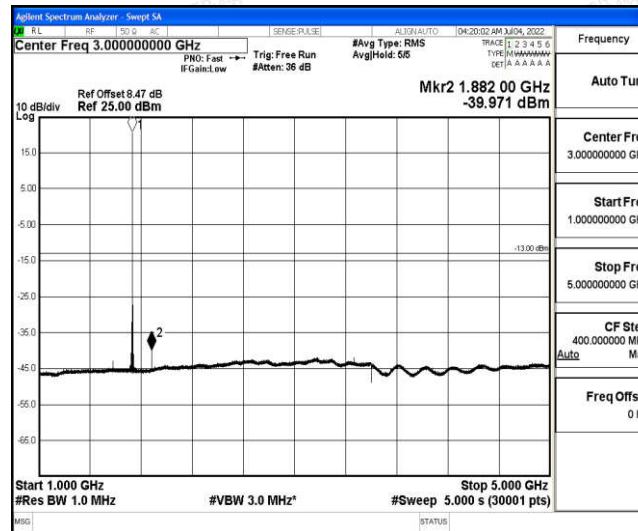

Band4-3MHz-QPSK-20175-1-0-Low-1000-5000--39.97-PASS

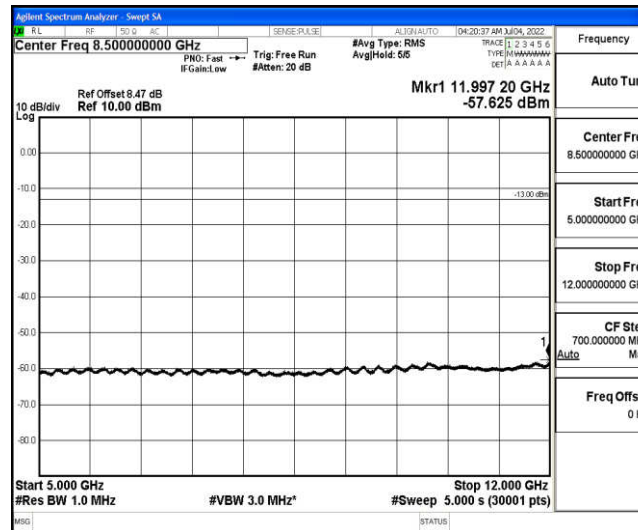


Band4-3MHz-QPSK-20175-1-0-Low-5000-12000--57.63-PASS

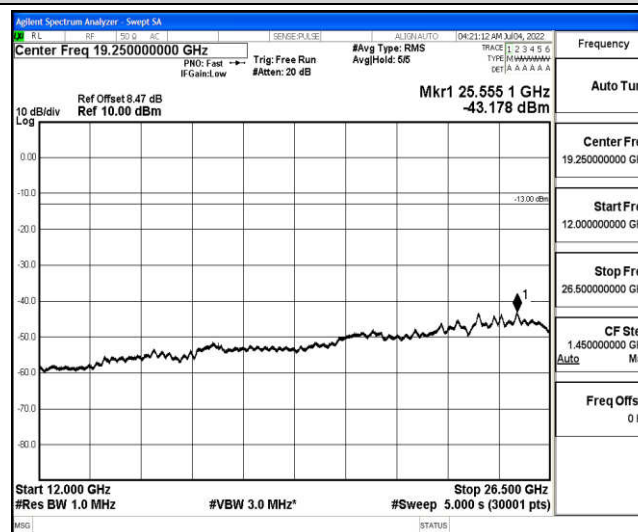


Band4-3MHz-QPSK-20175-1-0-Low-12000-26500--43.18-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

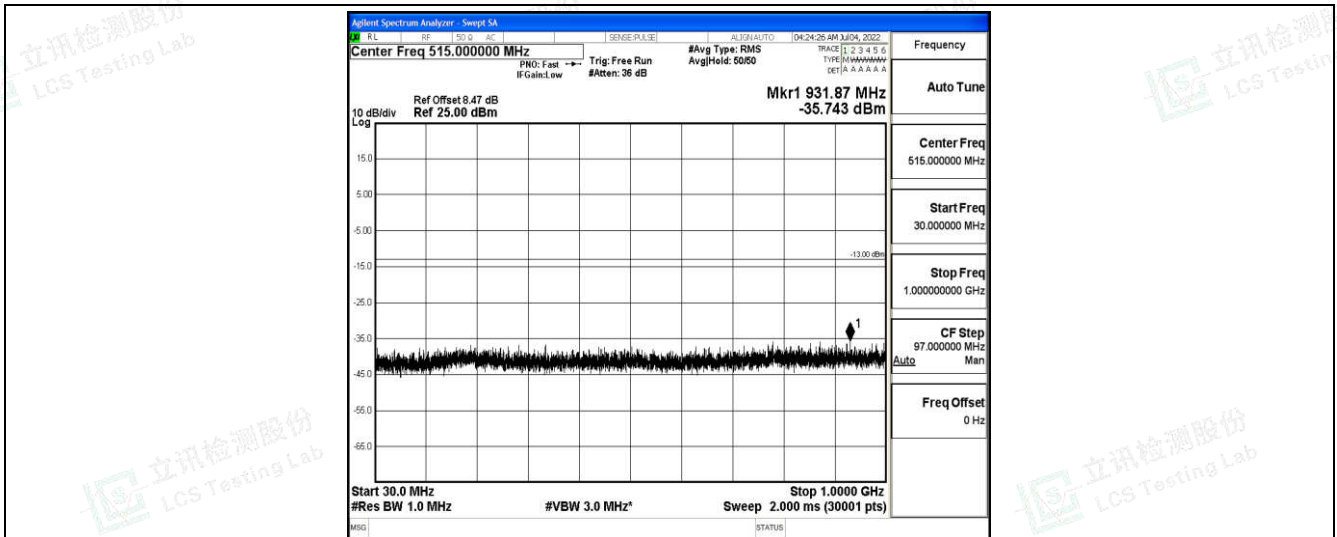

Band4-3MHz-QPSK-20385-1-0-High-30-1000--35.74-PASS

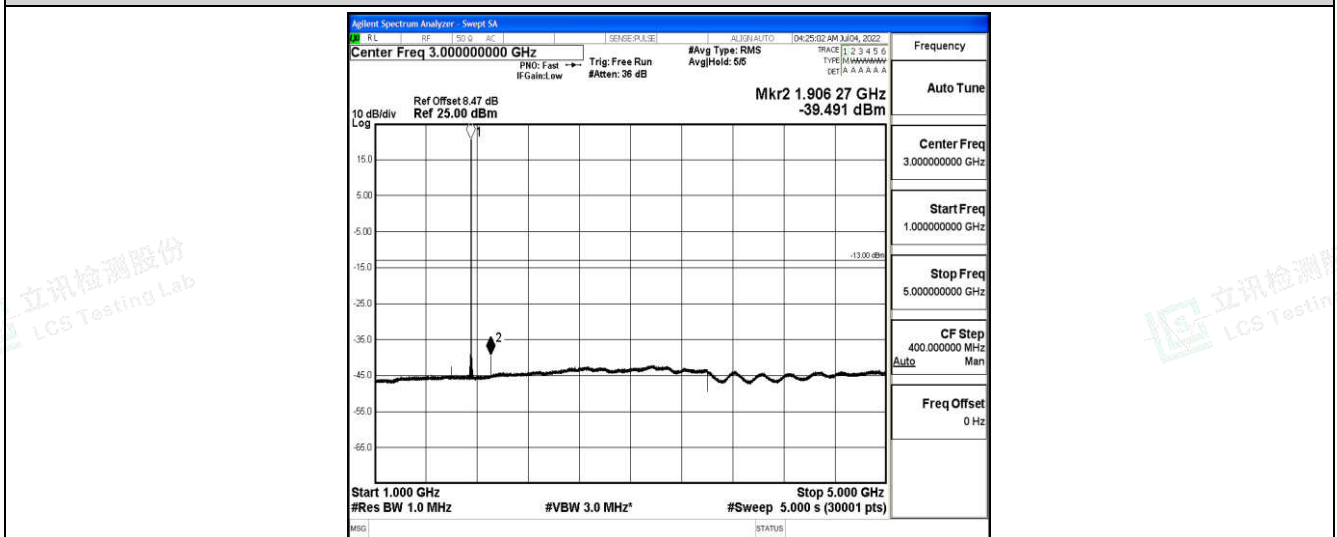


Band4-3MHz-QPSK-20385-1-0-High-1000-5000--39.49-PASS

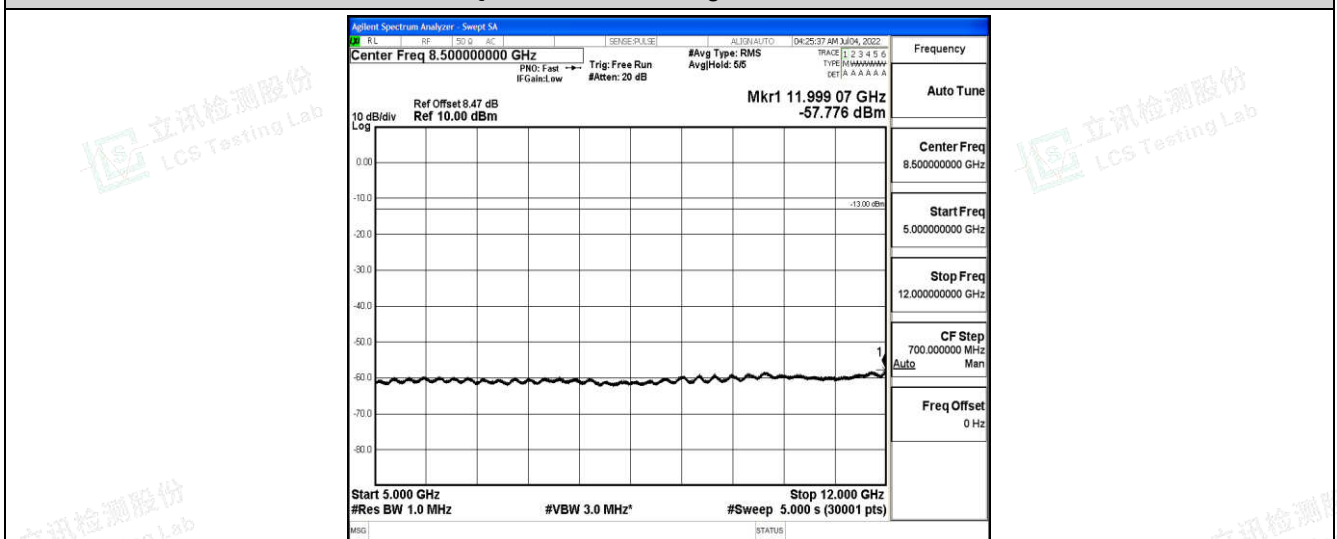


Band4-3MHz-QPSK-20385-1-0-High-5000-12000--57.78-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

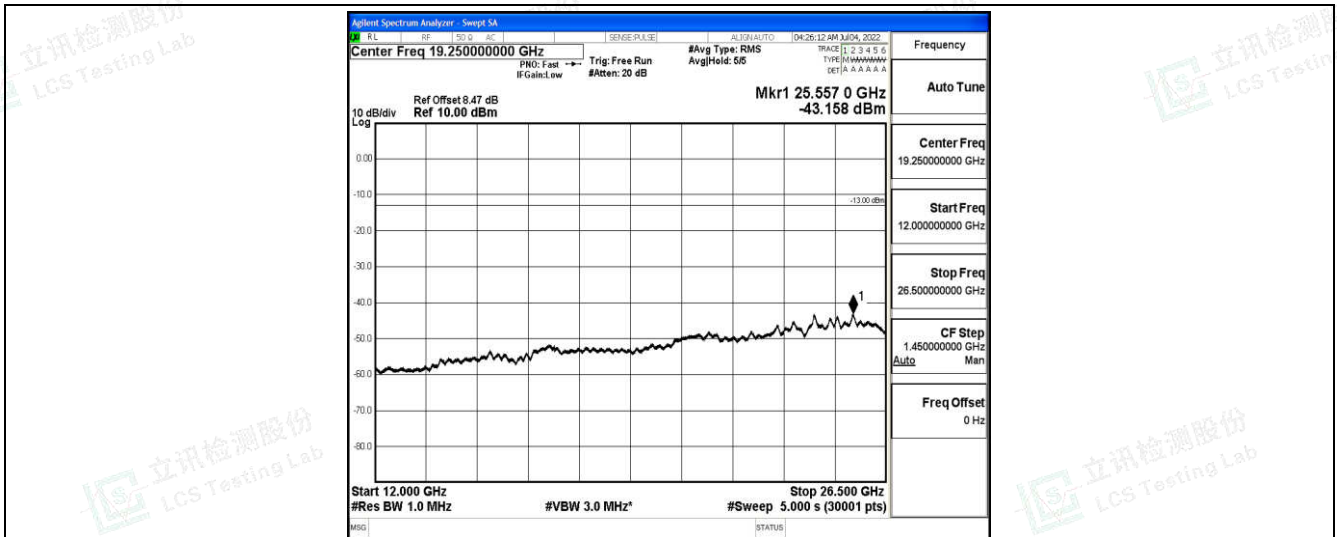

Band4-3MHz-QPSK-20385-1-0-High-12000-26500--43.16-PASS

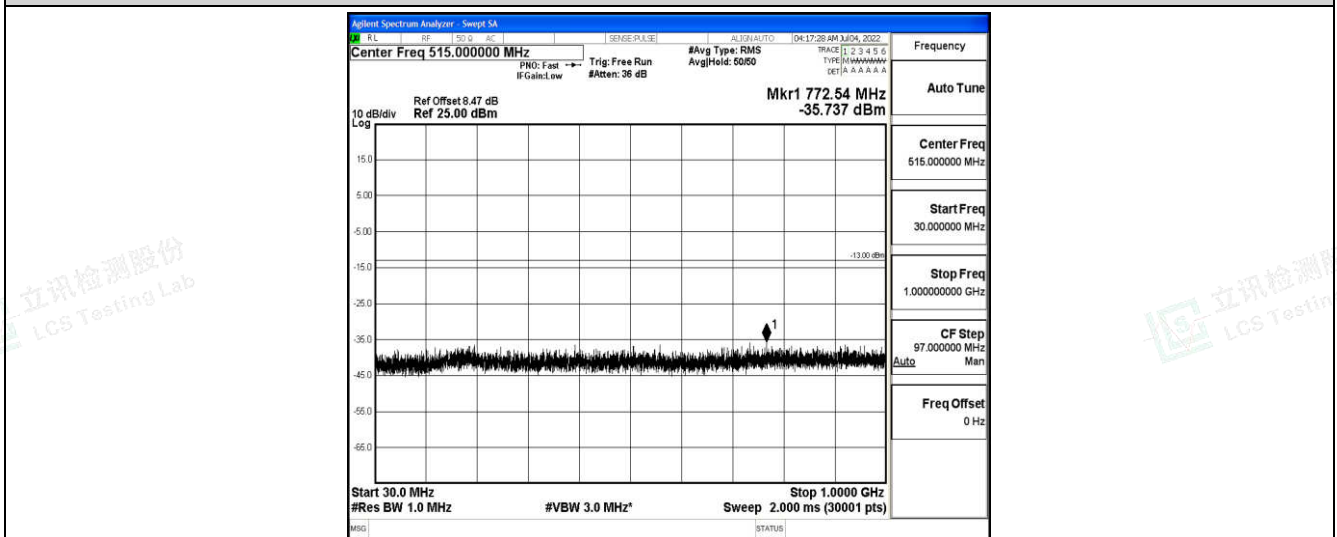


Band4-3MHz-16QAM-19965-1-0-Low-30-1000--35.74-PASS

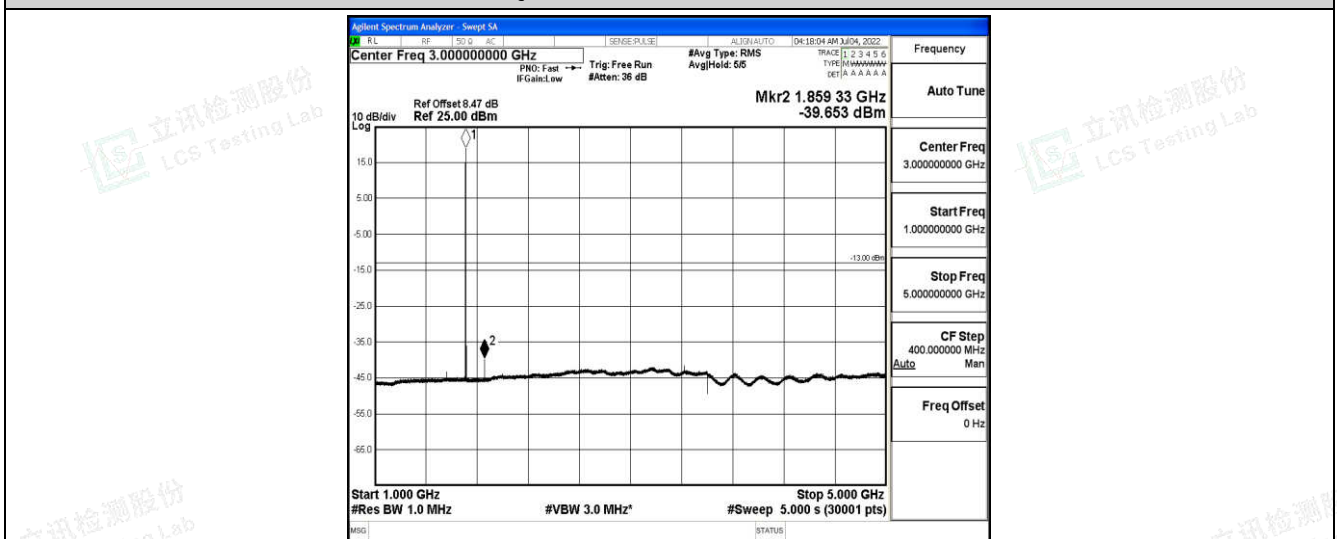


Band4-3MHz-16QAM-19965-1-0-Low-1000-5000--39.65-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

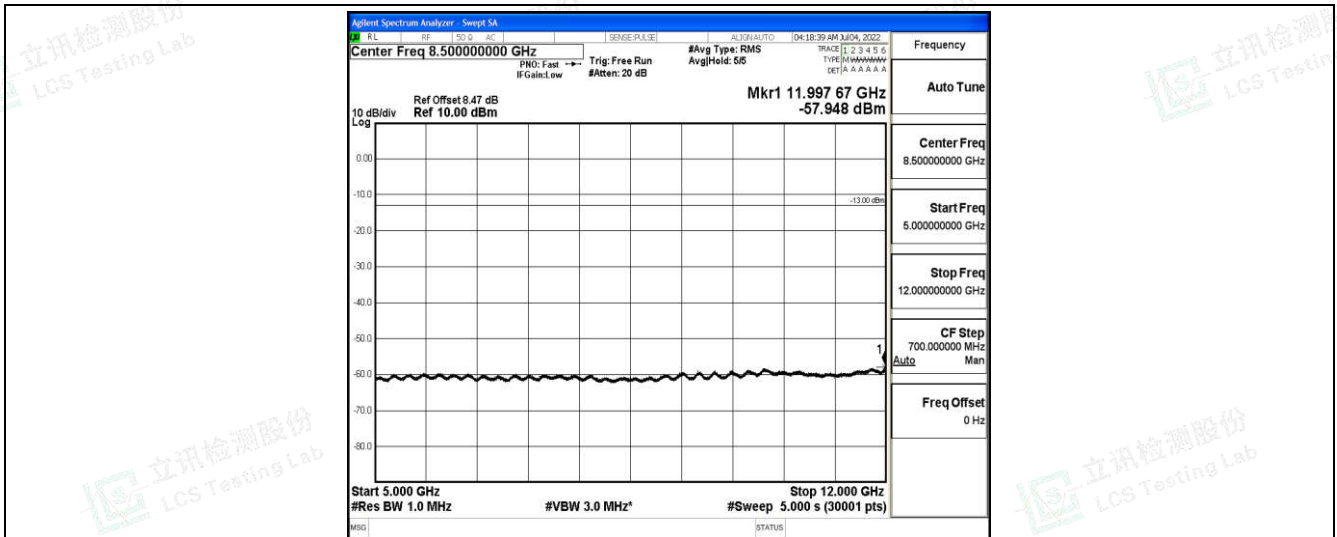

Band4-3MHz-16QAM-19965-1-0-Low-5000-12000--57.95-PASS

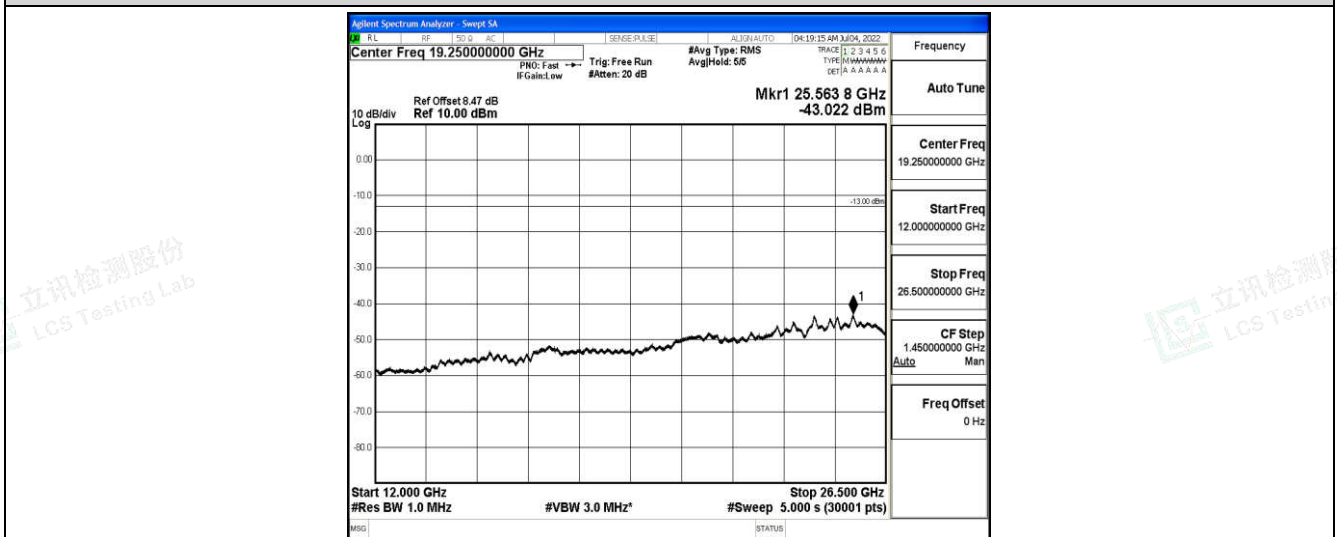


Band4-3MHz-16QAM-19965-1-0-Low-12000-26500--43.02-PASS

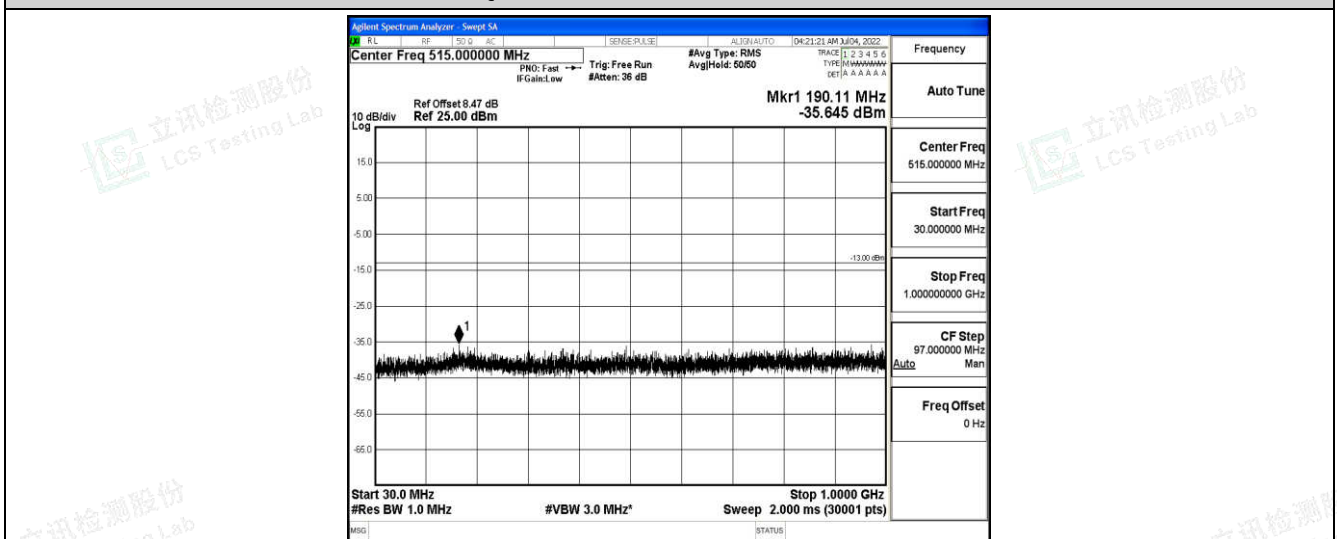


Band4-3MHz-16QAM-20175-1-0-Low-30-1000--35.65-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

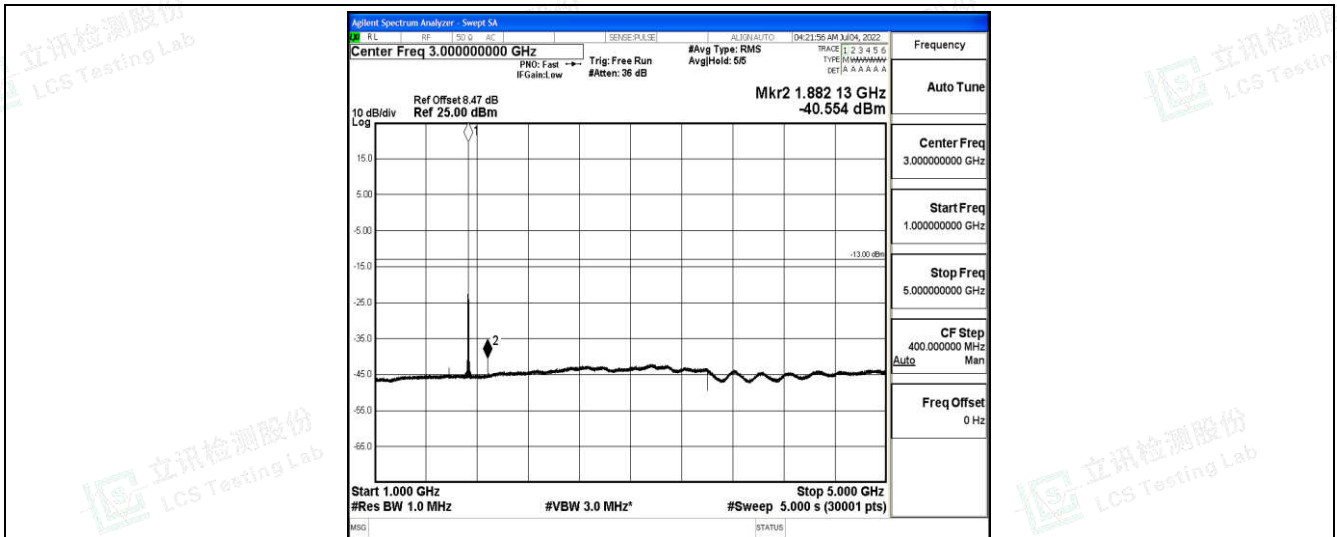

Band4-3MHz-16QAM-20175-1-0-Low-1000-5000--40.55-PASS

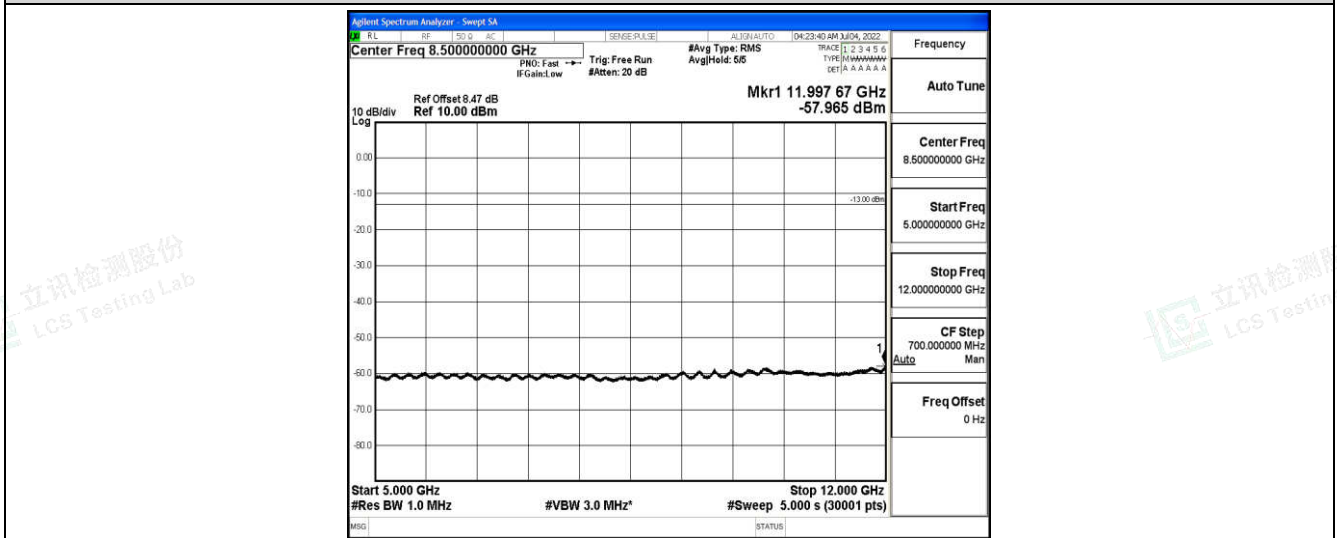


Band4-3MHz-16QAM-20175-1-0-Low-5000-12000--57.97-PASS

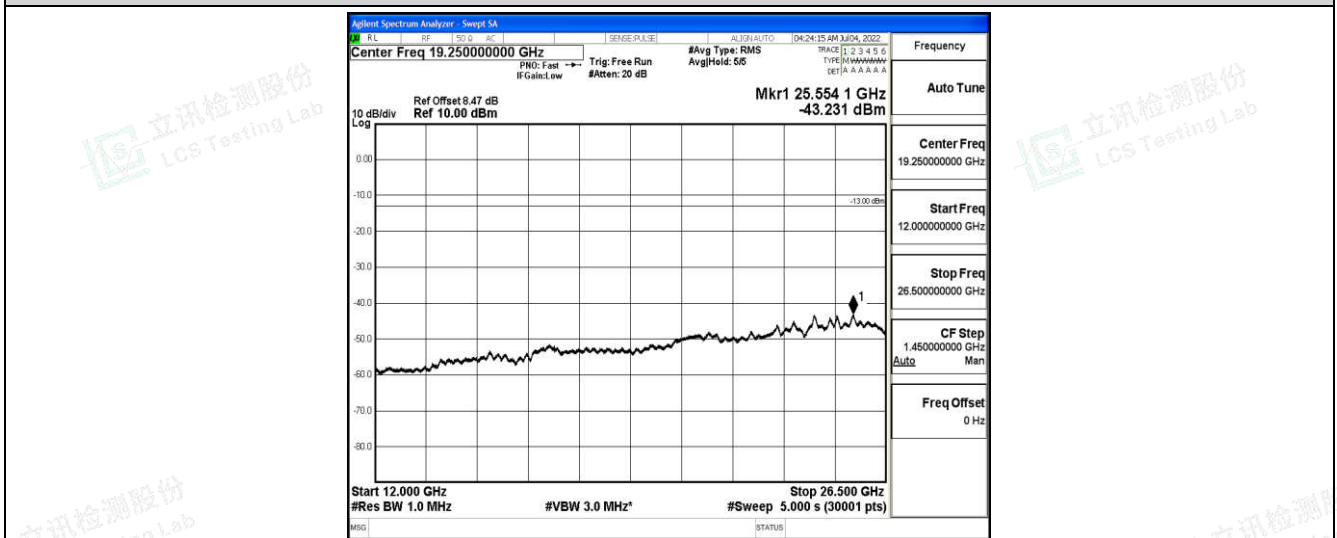


Band4-3MHz-16QAM-20175-1-0-Low-12000-26500--43.23-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

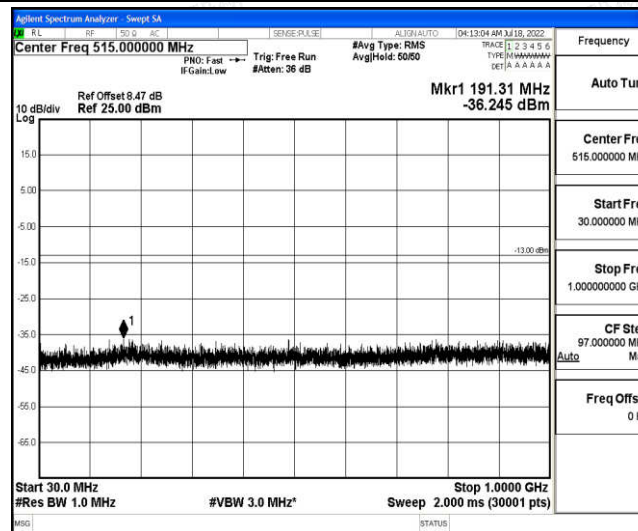

Band4-3MHz-16QAM-20385-1-0-High-30-1000--36.25-PASS

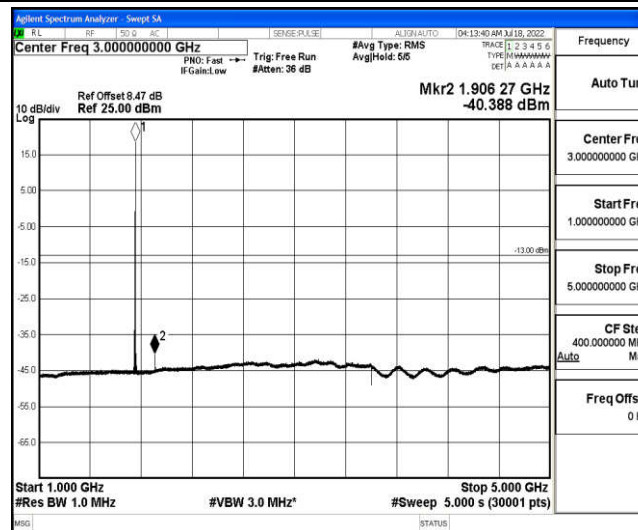


Band4-3MHz-16QAM-20385-1-0-High-1000-5000--40.39-PASS

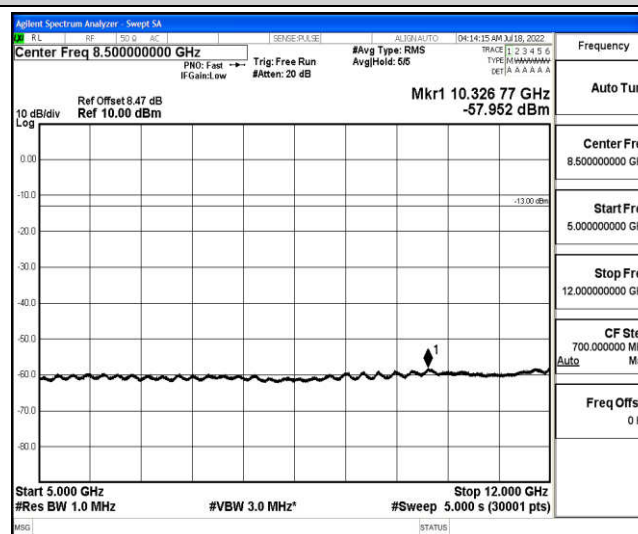


Band4-3MHz-16QAM-20385-1-0-High-5000-12000--57.95-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

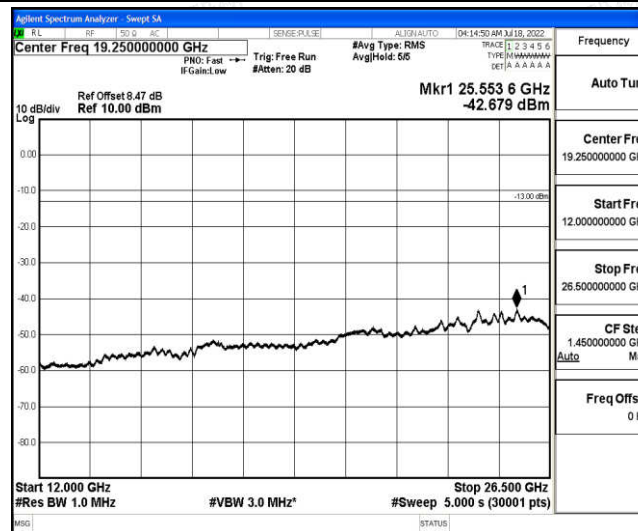

Band4-3MHz-16QAM-20385-1-0-High-12000-26500--42.68-PASS

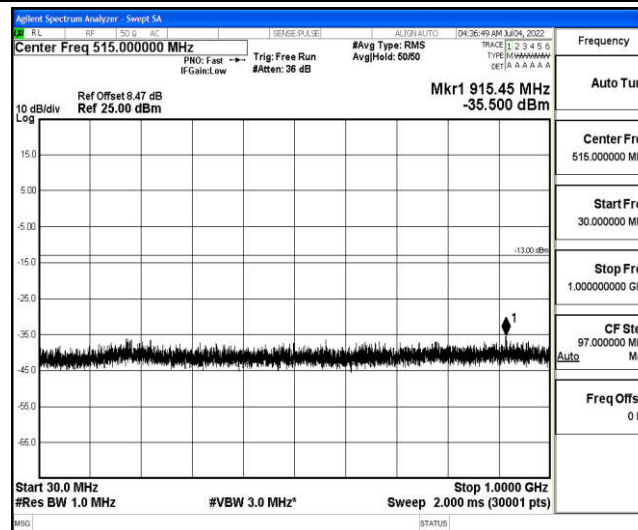


Band4-5MHz-QPSK-19975-1-0-Low-30-1000--35.5-PASS

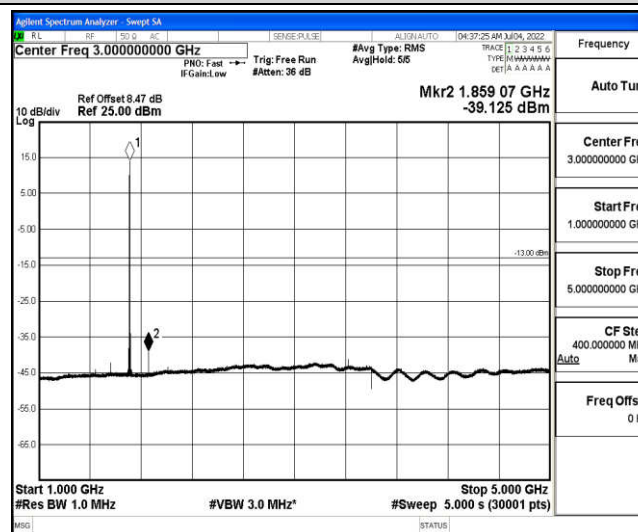


Band4-5MHz-QPSK-19975-1-0-Low-1000-5000--39.13-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

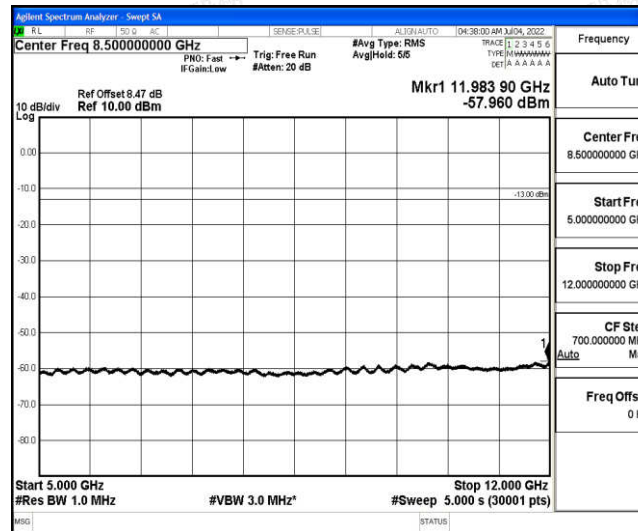

Band4-5MHz-QPSK-19975-1-0-Low-5000-12000--57.96-PASS

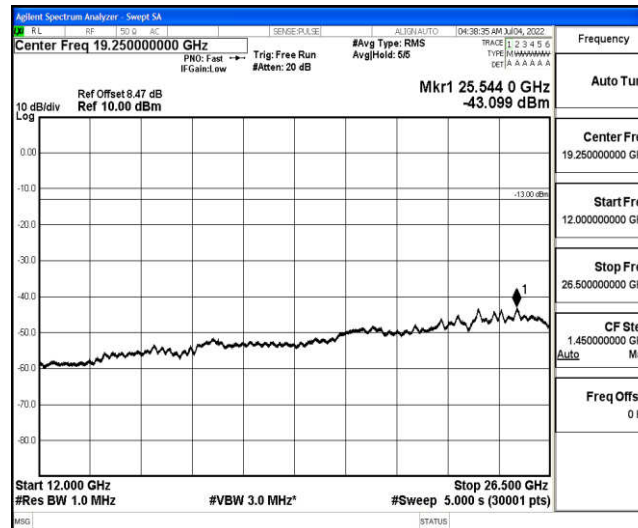


Band4-5MHz-QPSK-19975-1-0-Low-12000-26500--43.1-PASS

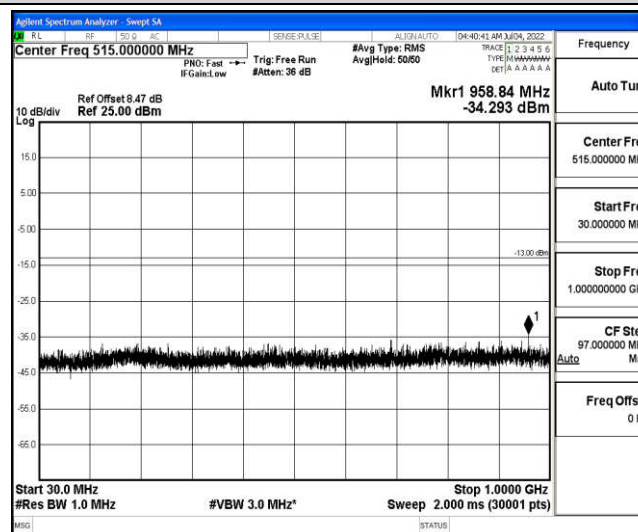


Band4-5MHz-QPSK-20175-1-0-Low-30-1000--34.29-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

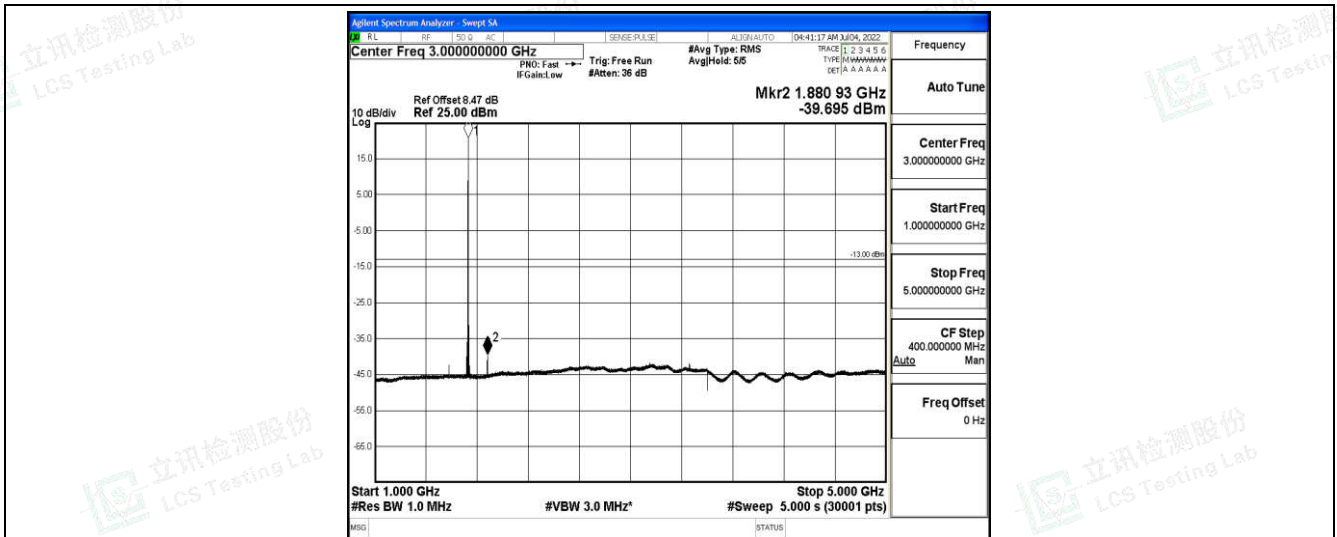

Band4-5MHz-QPSK-20175-1-0-Low-1000-5000--39.7-PASS

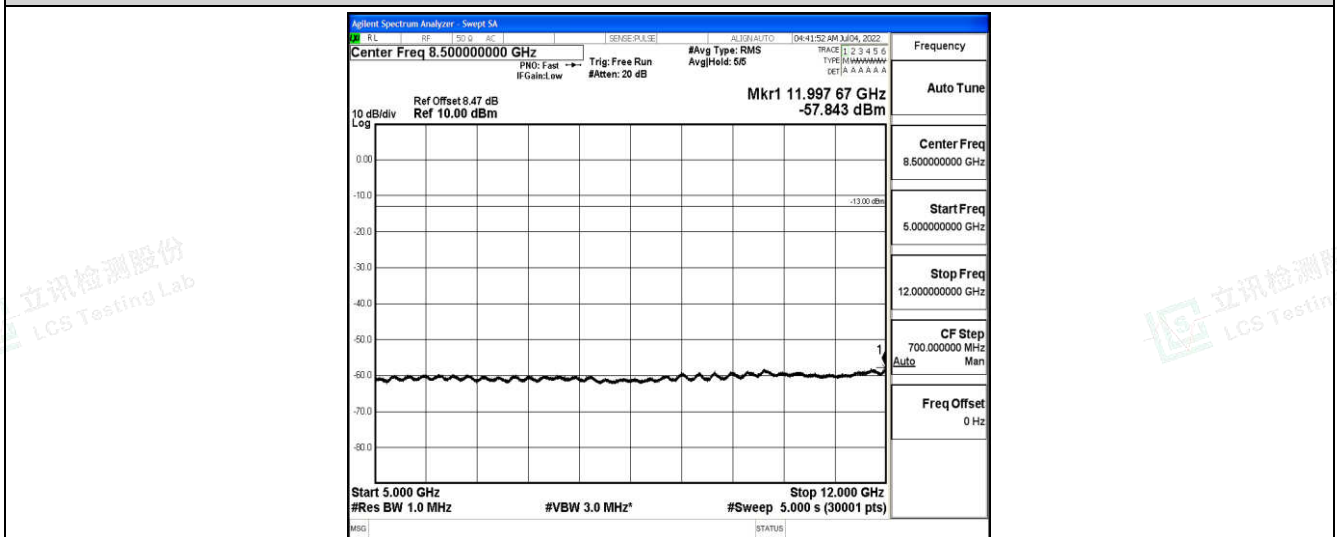


Band4-5MHz-QPSK-20175-1-0-Low-5000-12000--57.84-PASS

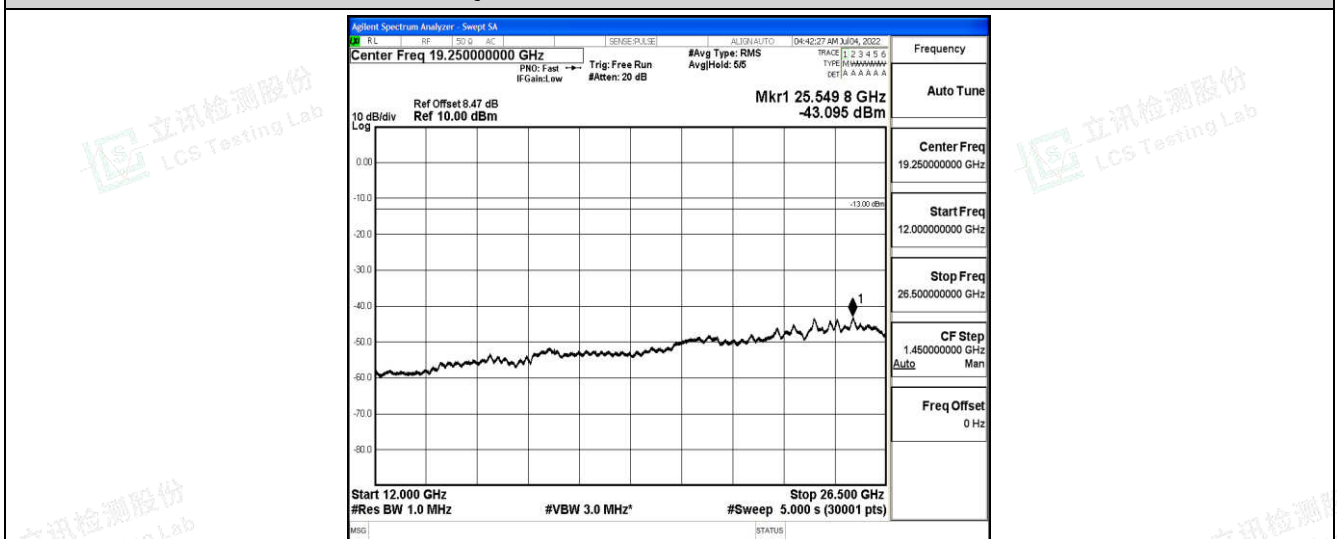


Band4-5MHz-QPSK-20175-1-0-Low-12000-26500--43.1-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

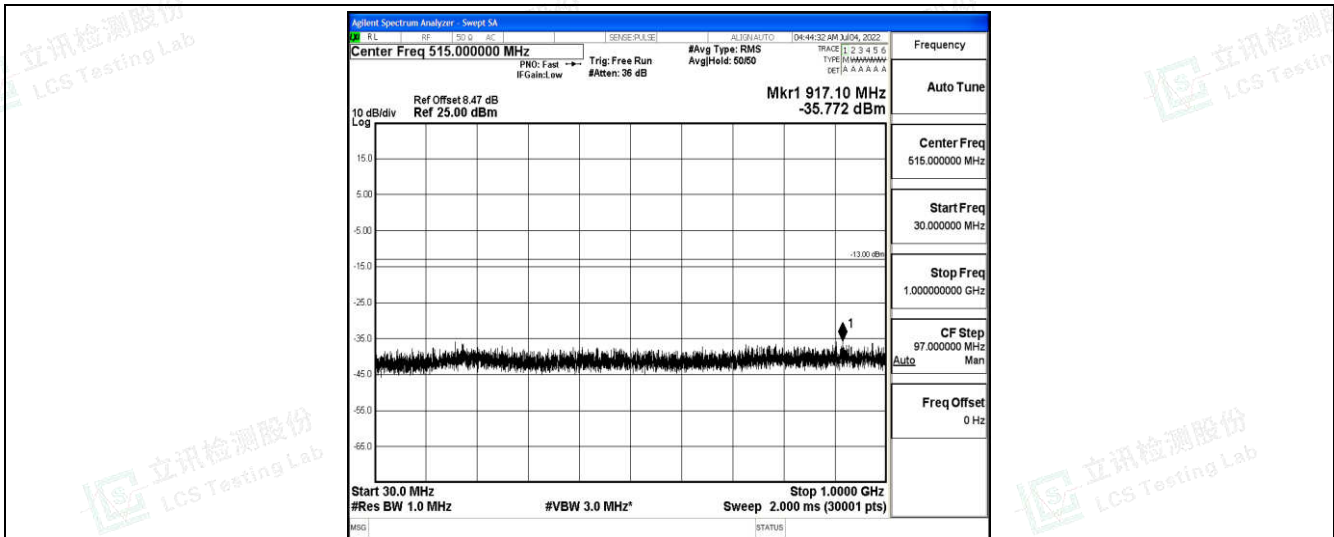

Band4-5MHz-QPSK-20375-1-0-High-30-1000--35.77-PASS

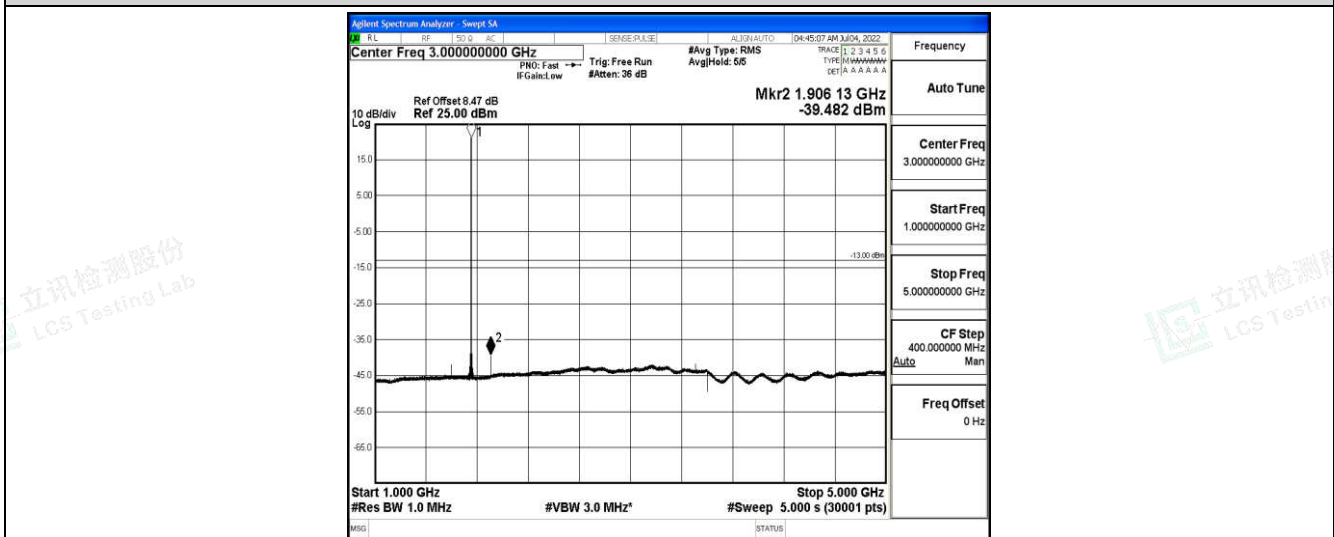


Band4-5MHz-QPSK-20375-1-0-High-1000-5000--39.48-PASS

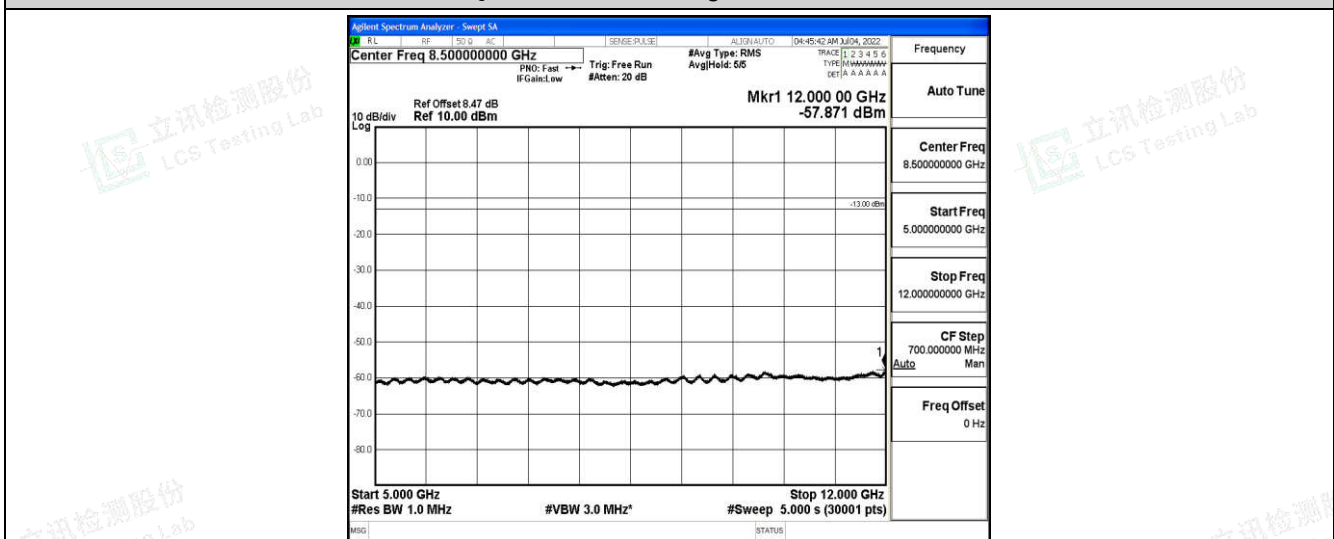


Band4-5MHz-QPSK-20375-1-0-High-5000-12000--57.87-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

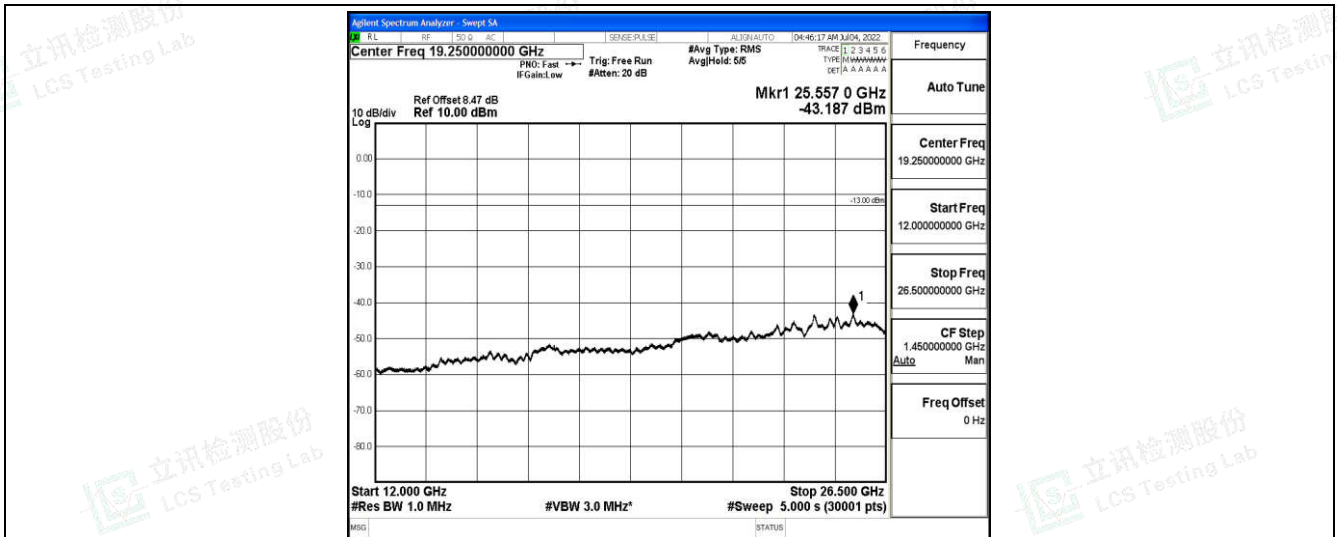

Band4-5MHz-QPSK-20375-1-0-High-12000-26500--43.19-PASS

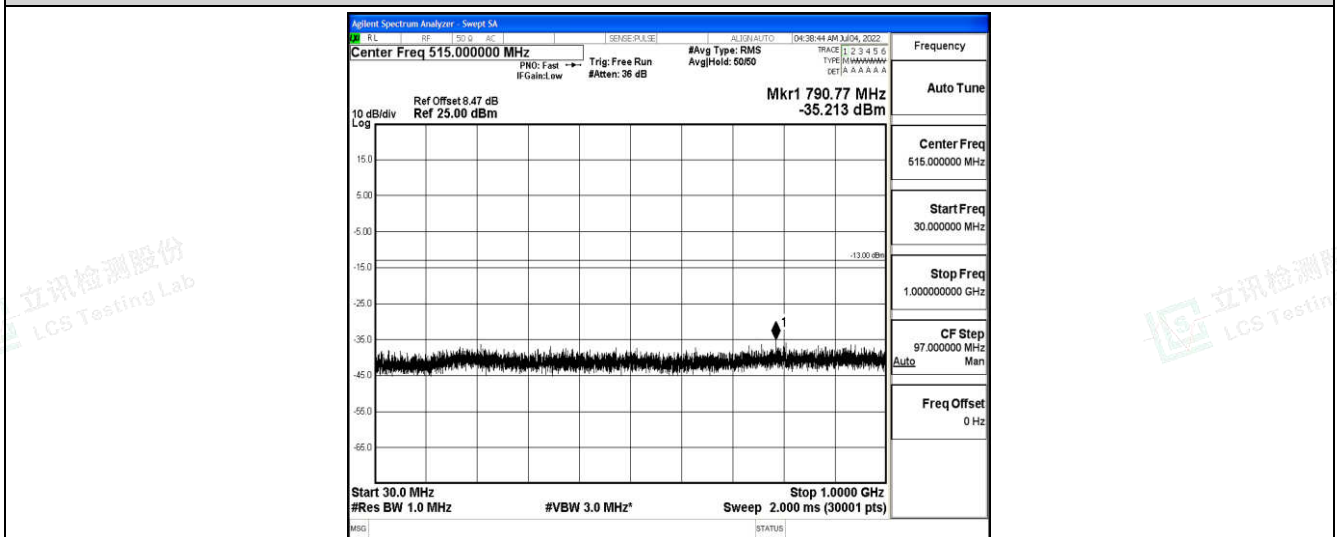


Band4-5MHz-16QAM-19975-1-0-Low-30-1000--35.21-PASS

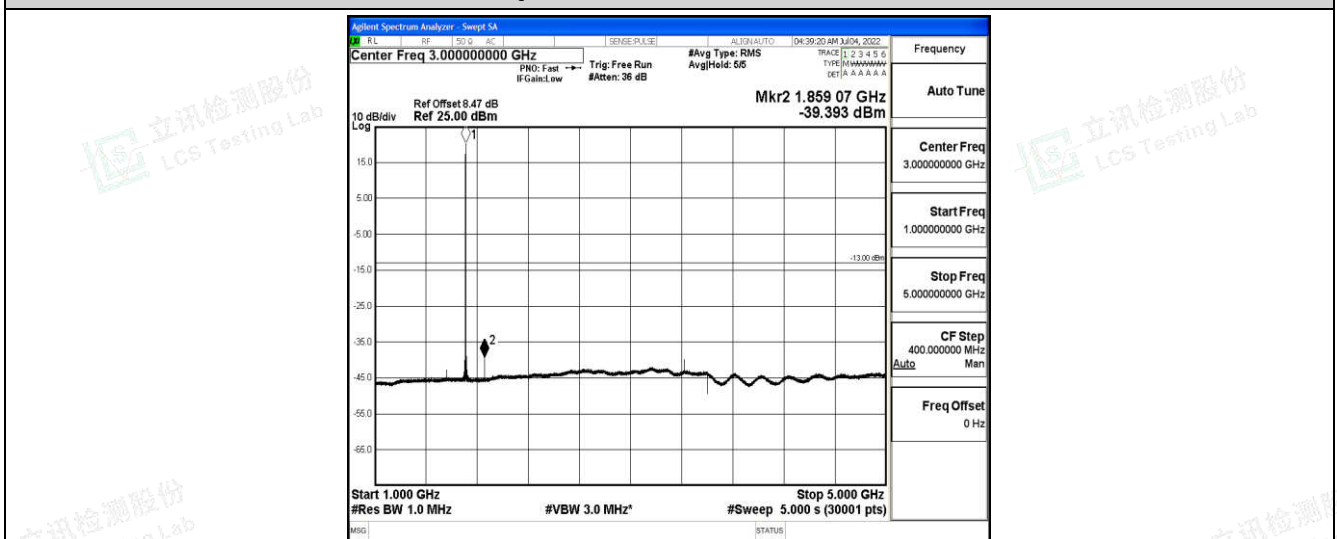


Band4-5MHz-16QAM-19975-1-0-Low-1000-5000--39.39-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

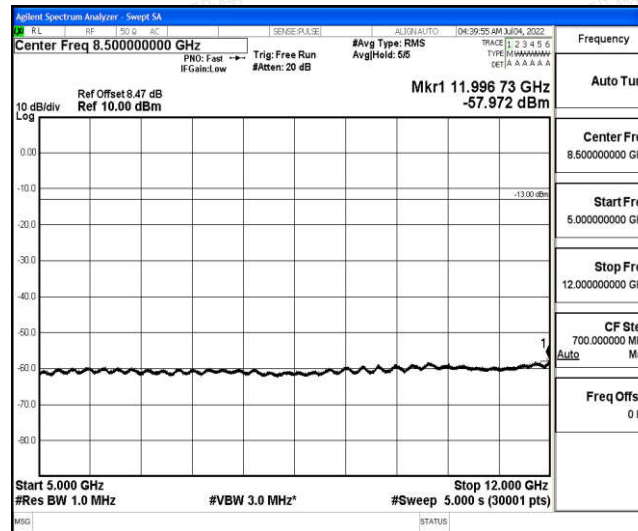

Band4-5MHz-16QAM-19975-1-0-Low-5000-12000--57.97-PASS

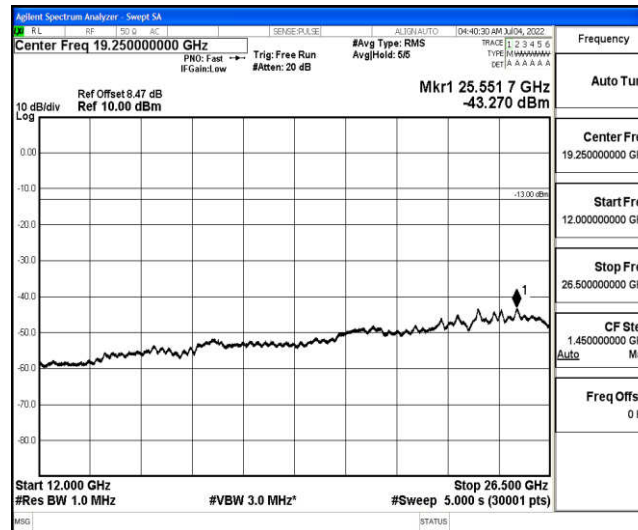


Band4-5MHz-16QAM-19975-1-0-Low-12000-26500--43.27-PASS

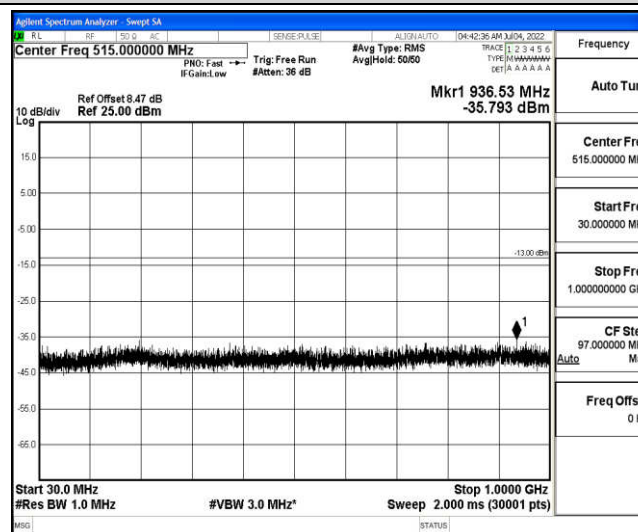


Band4-5MHz-16QAM-20175-1-0-Low-30-1000--35.79-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

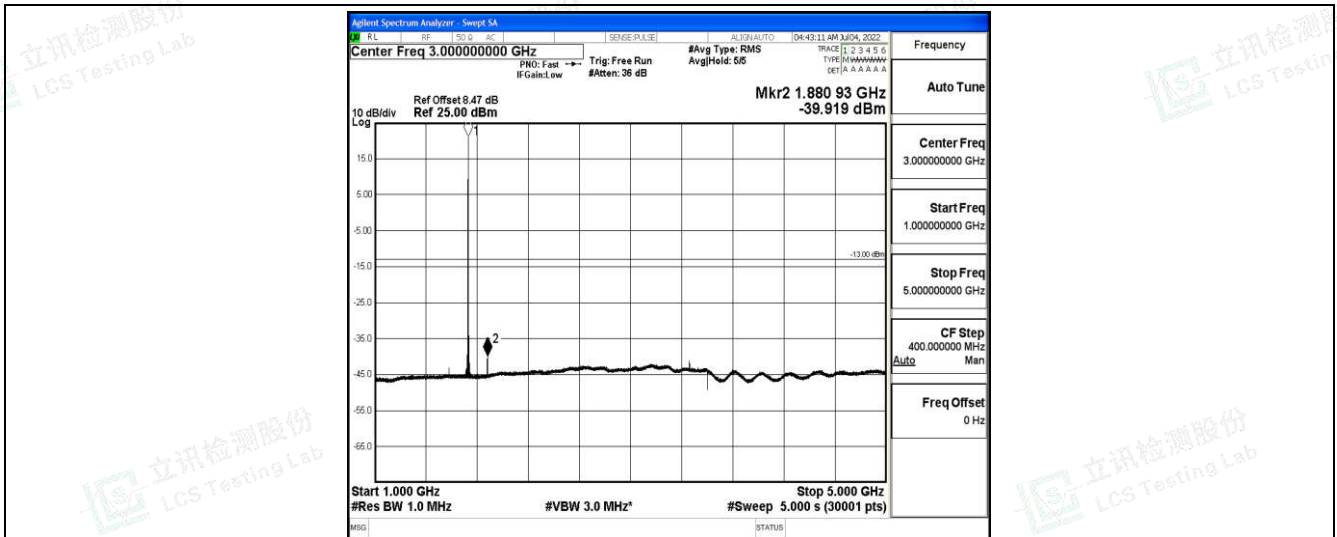

Band4-5MHz-16QAM-20175-1-0-Low-1000-5000--39.92-PASS

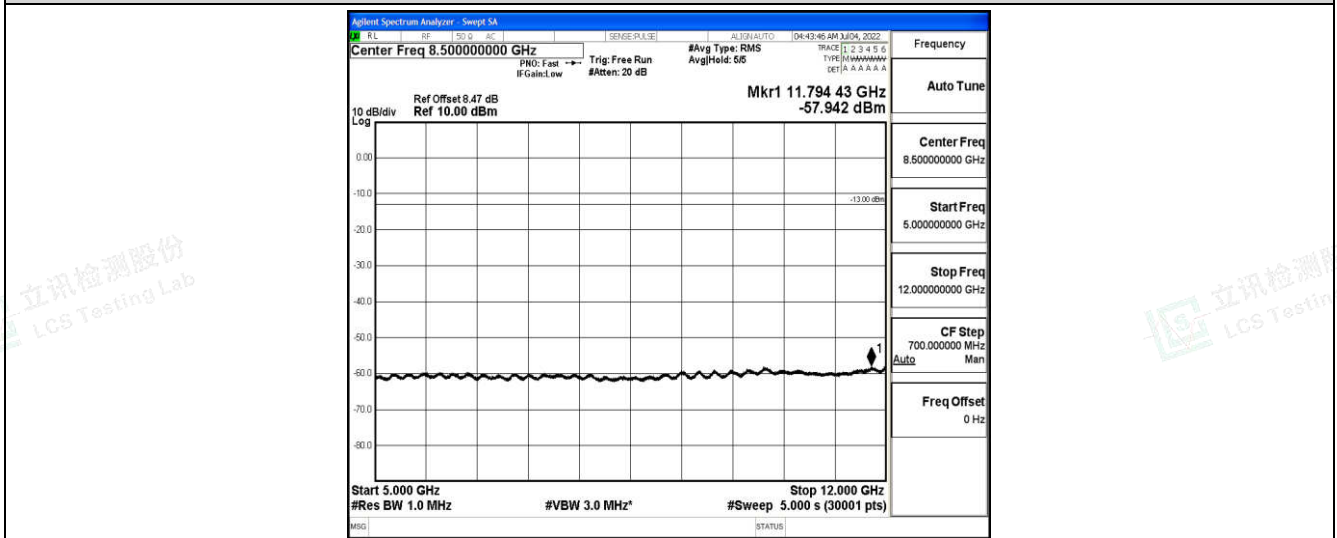


Band4-5MHz-16QAM-20175-1-0-Low-5000-12000--57.94-PASS

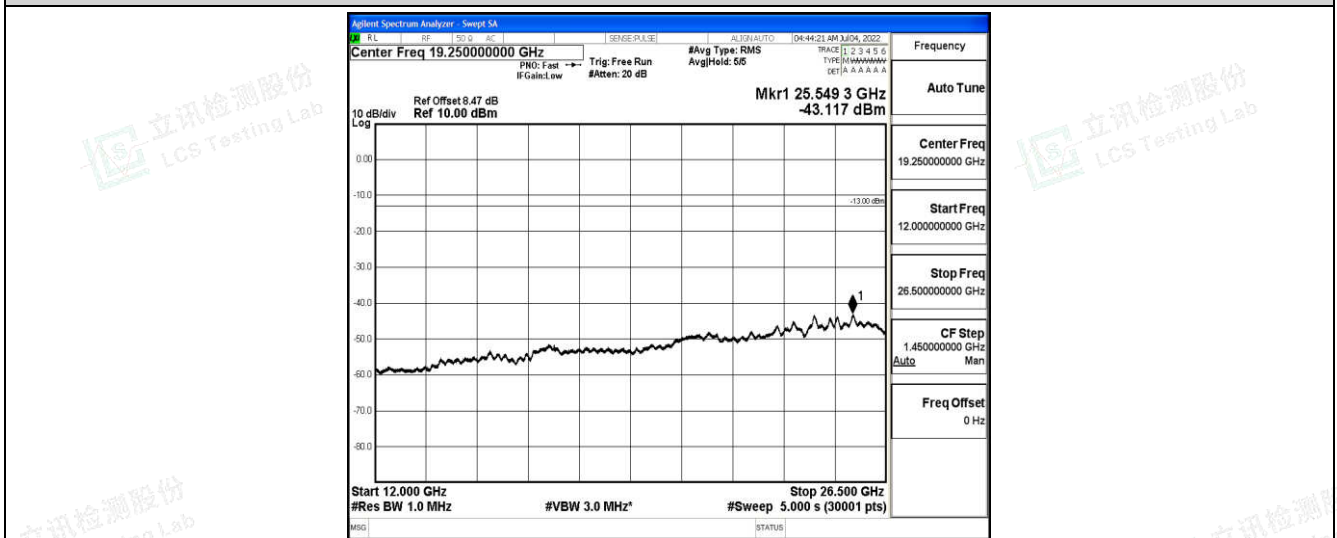


Band4-5MHz-16QAM-20175-1-0-Low-12000-26500--43.12-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

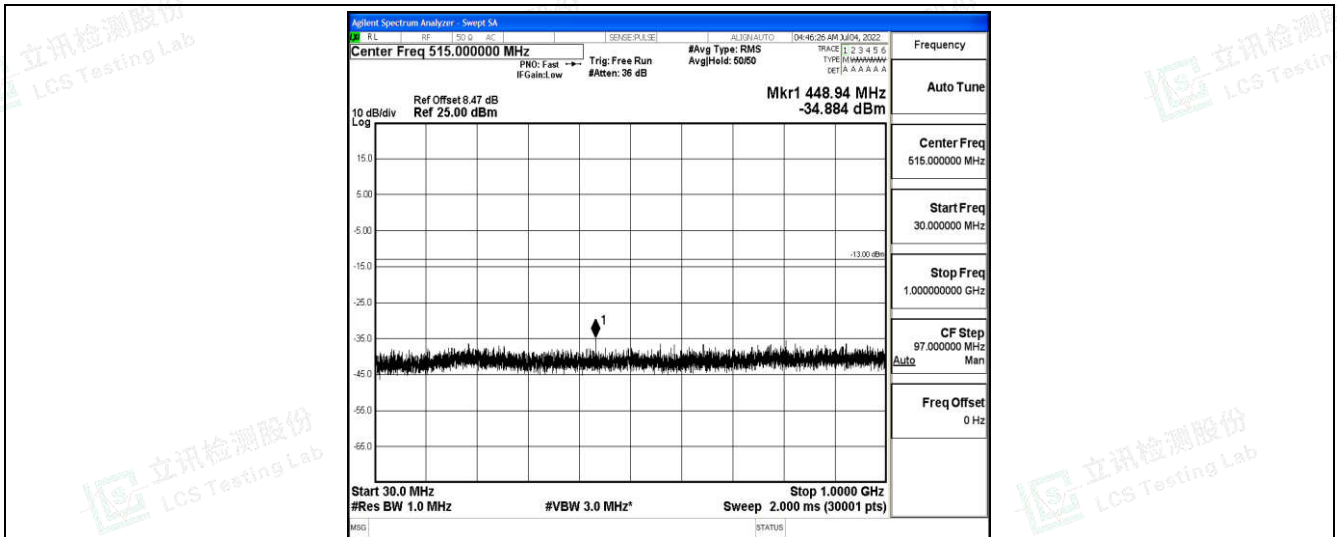

Band4-5MHz-16QAM-20375-1-0-High-30-1000--34.88-PASS

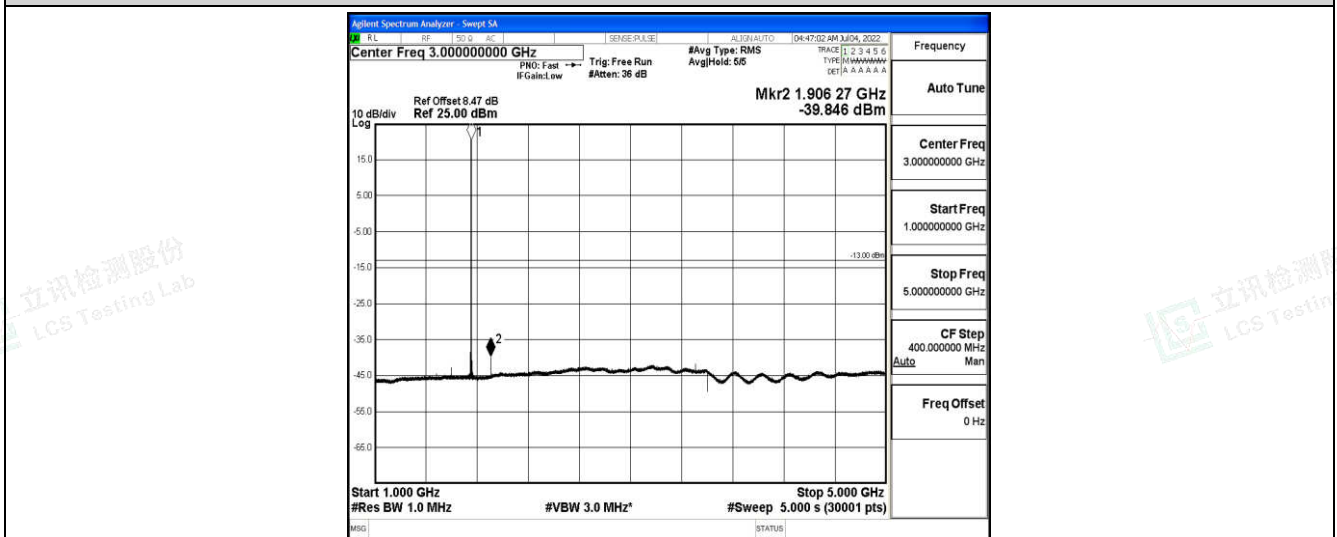


Band4-5MHz-16QAM-20375-1-0-High-1000-5000--39.85-PASS

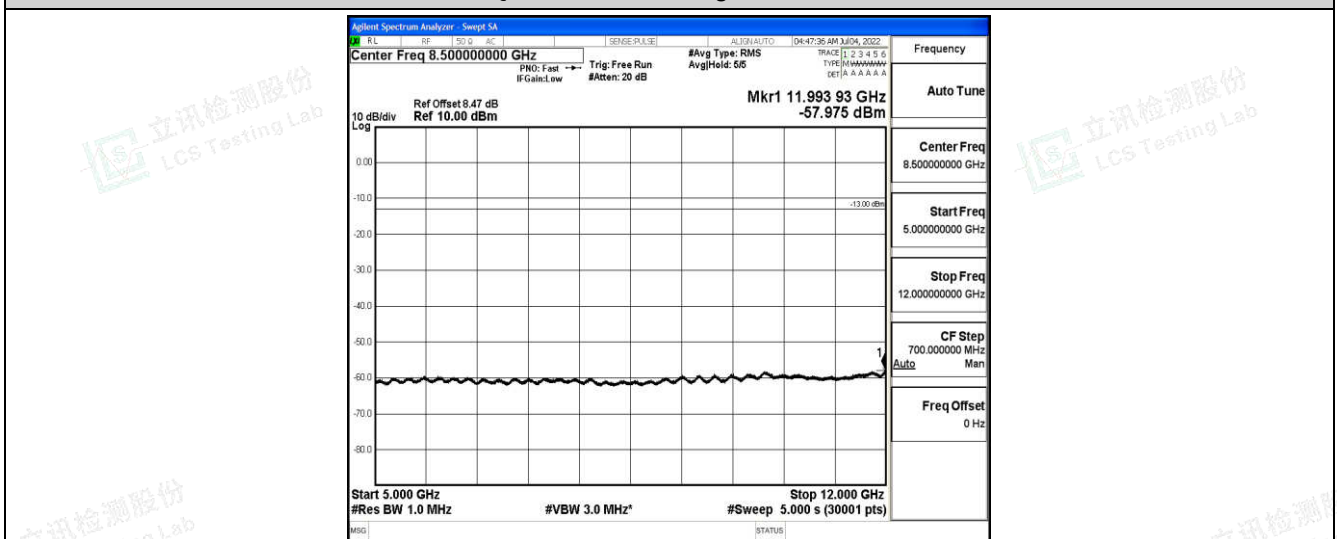


Band4-5MHz-16QAM-20375-1-0-High-5000-12000--57.98-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

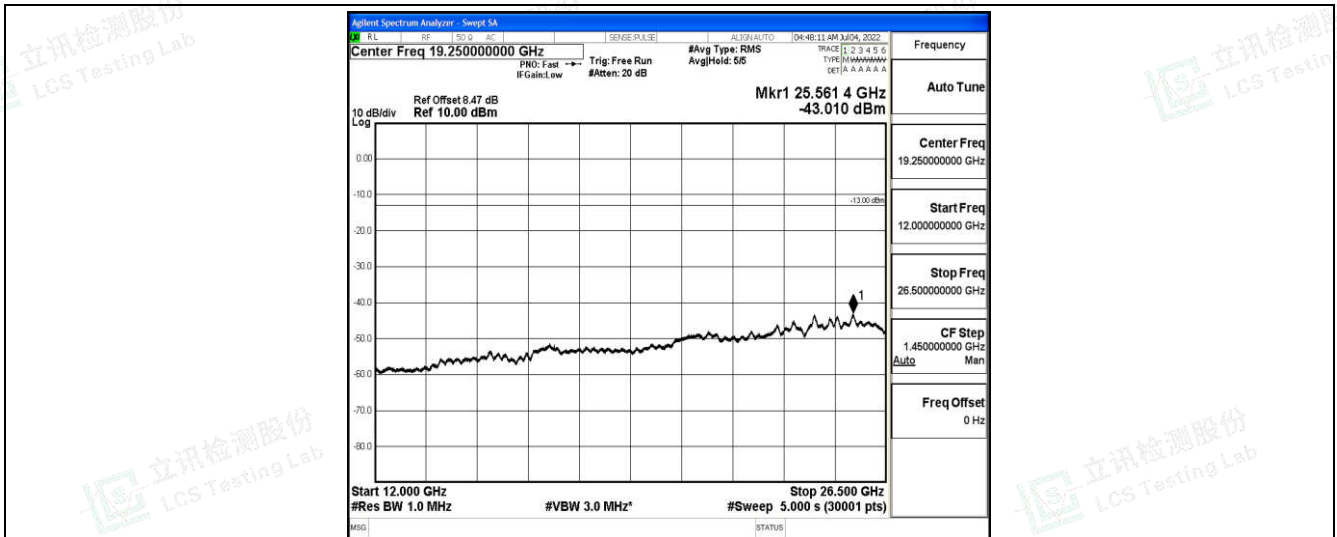

Band4-5MHz-16QAM-20375-1-0-High-12000-26500--43.01-PASS

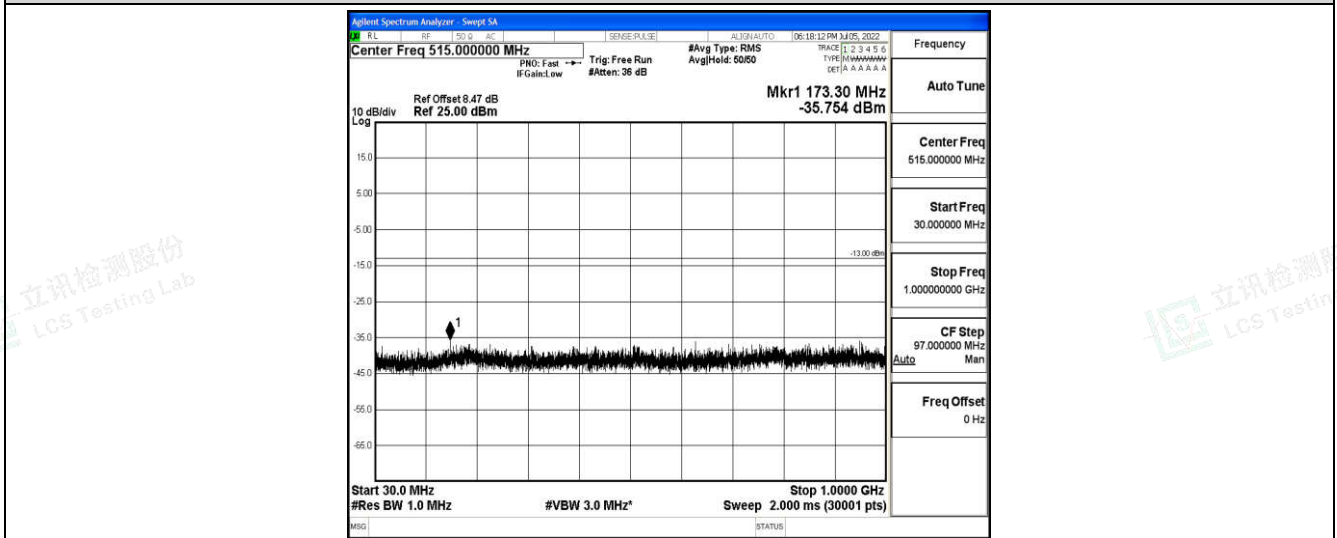


Band4-10MHz-QPSK-20000-1-0-Low-30-1000--35.75-PASS

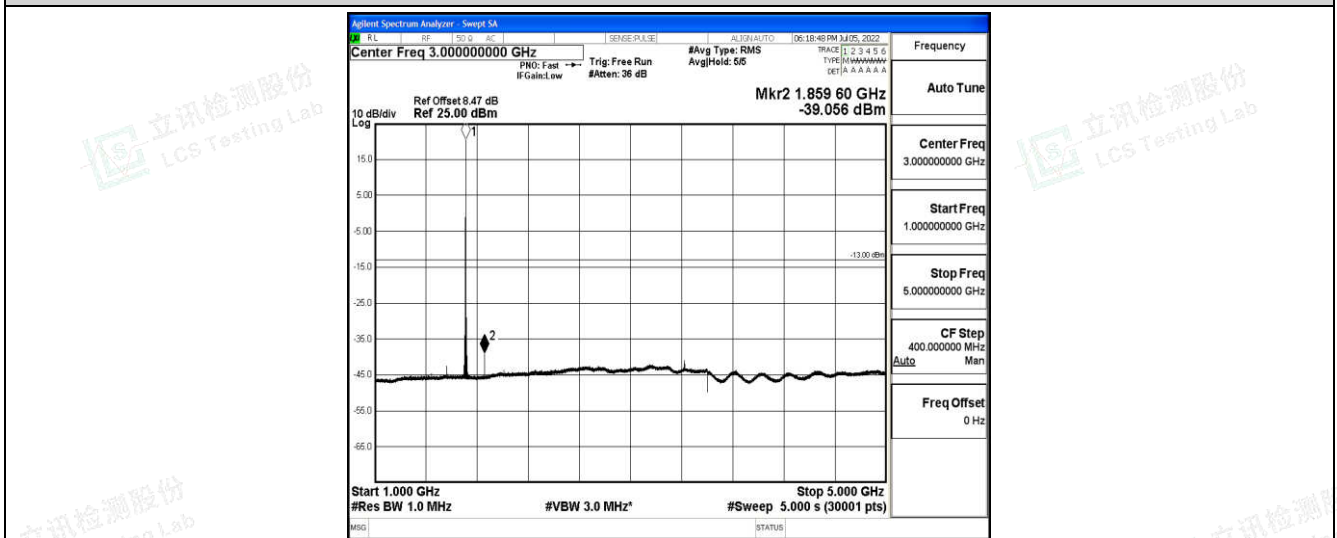


Band4-10MHz-QPSK-20000-1-0-Low-1000-5000--39.06-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

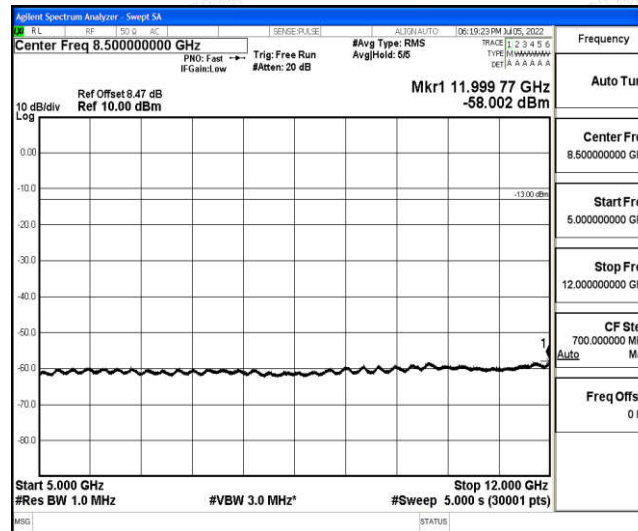

Band4-10MHz-QPSK-20000-1-0-Low-5000-12000--58-PASS

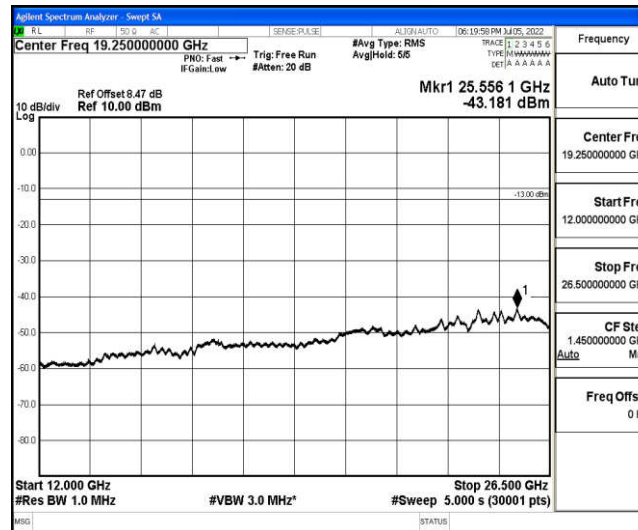


Band4-10MHz-QPSK-20000-1-0-Low-12000-26500--43.18-PASS

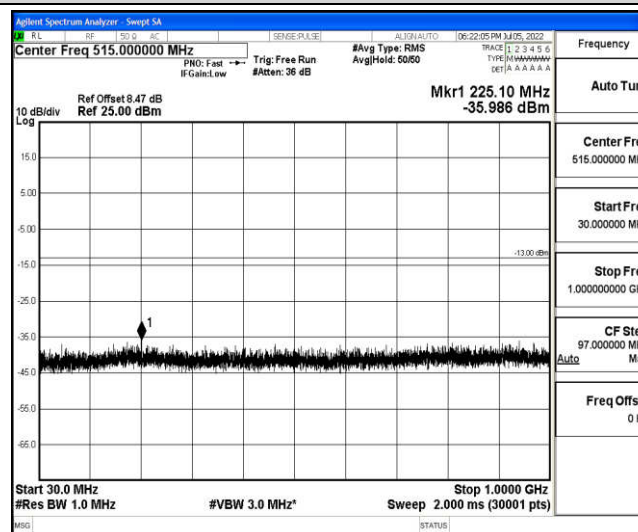


Band4-10MHz-QPSK-20175-1-0-Low-30-1000--35.99-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

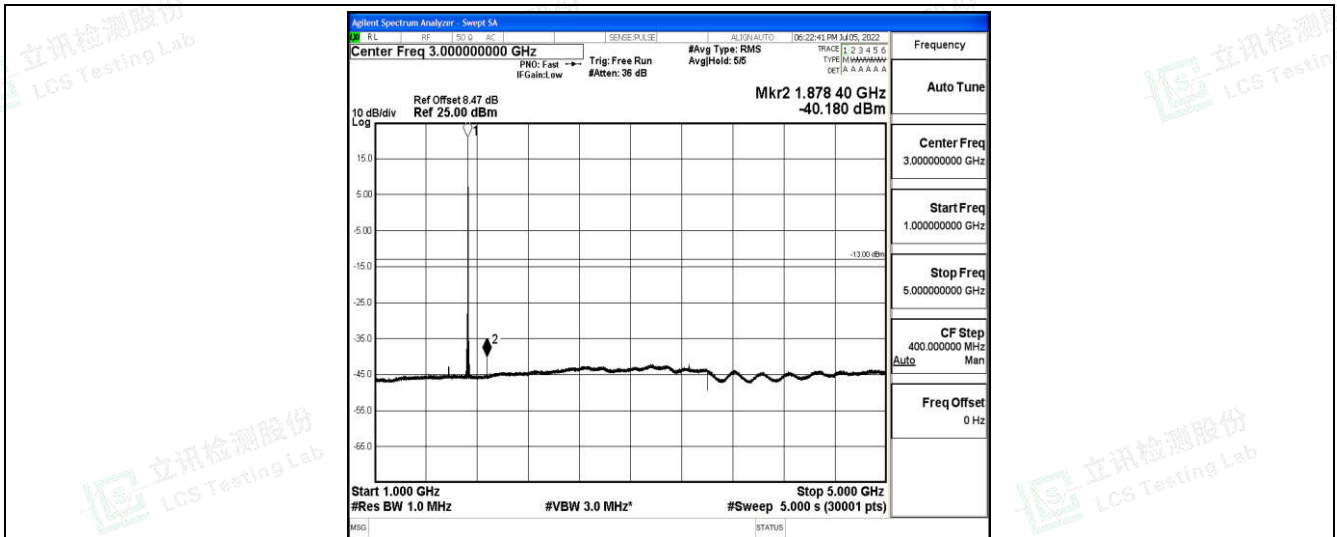

Band4-10MHz-QPSK-20175-1-0-Low-1000-5000--40.18-PASS

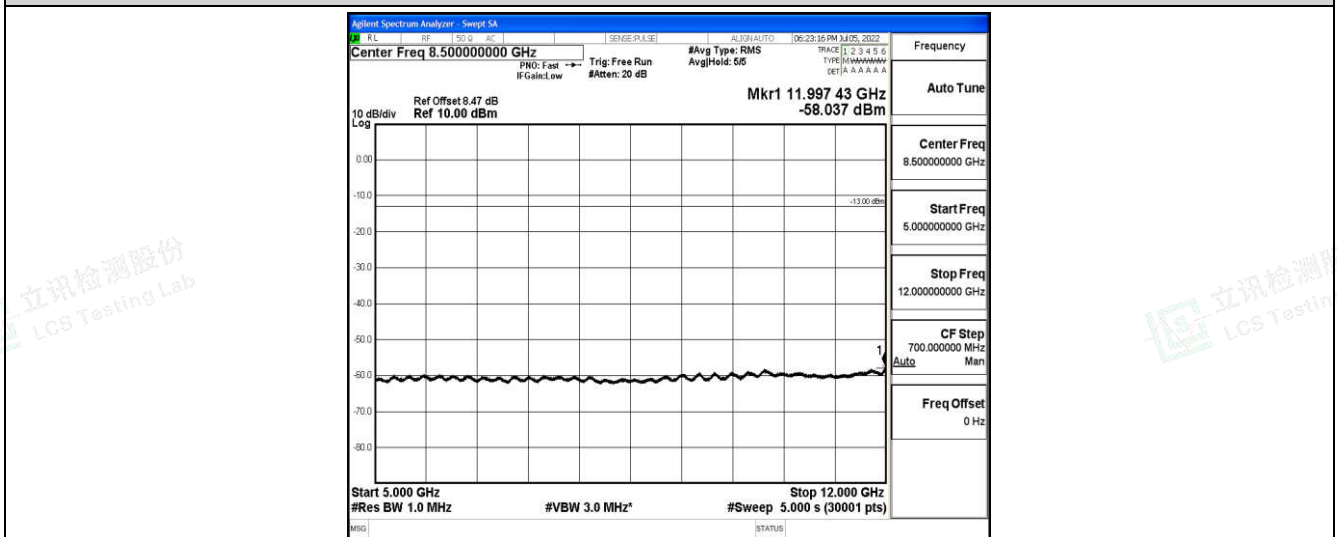


Band4-10MHz-QPSK-20175-1-0-Low-5000-12000--58.04-PASS

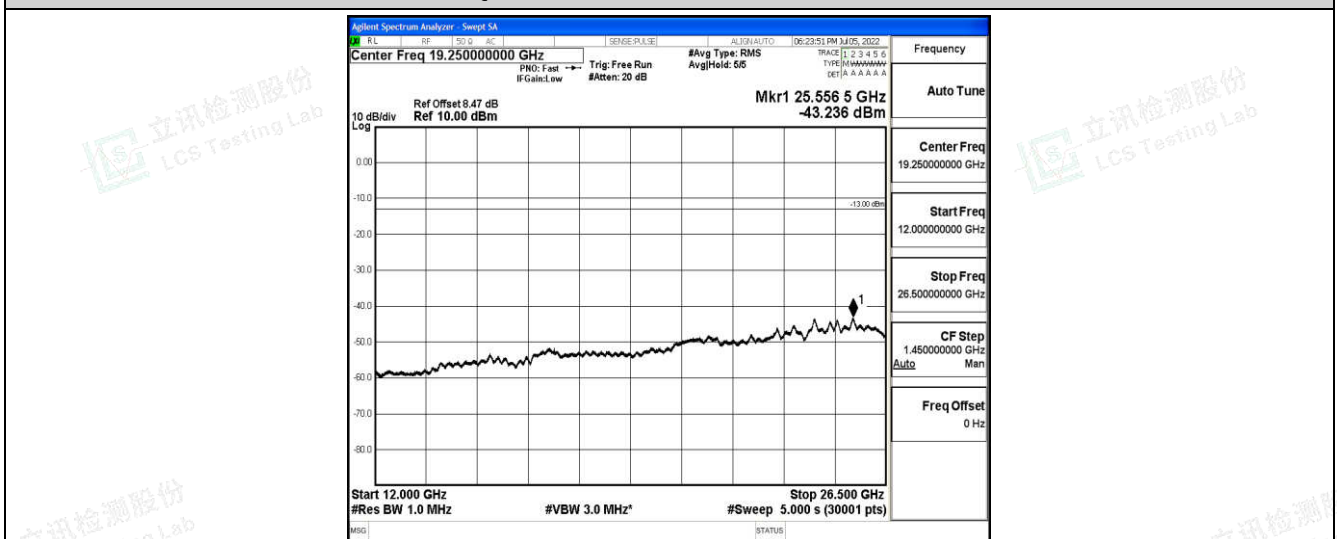


Band4-10MHz-QPSK-20175-1-0-Low-12000-26500--43.24-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

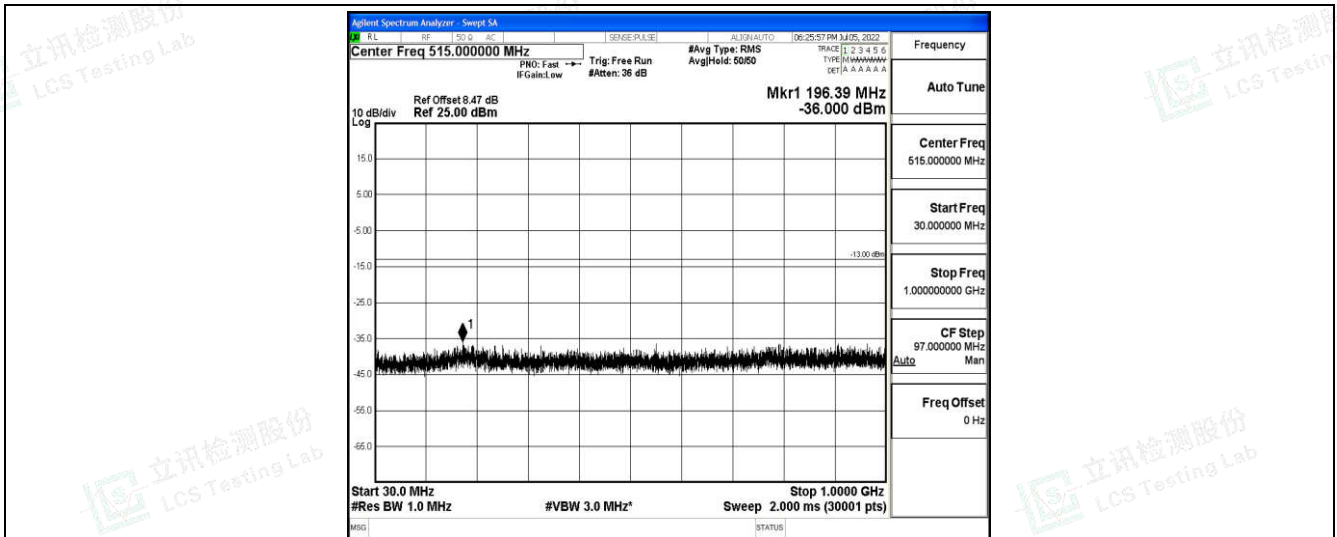

Band4-10MHz-QPSK-20350-1-0-High-30-1000--36-PASS

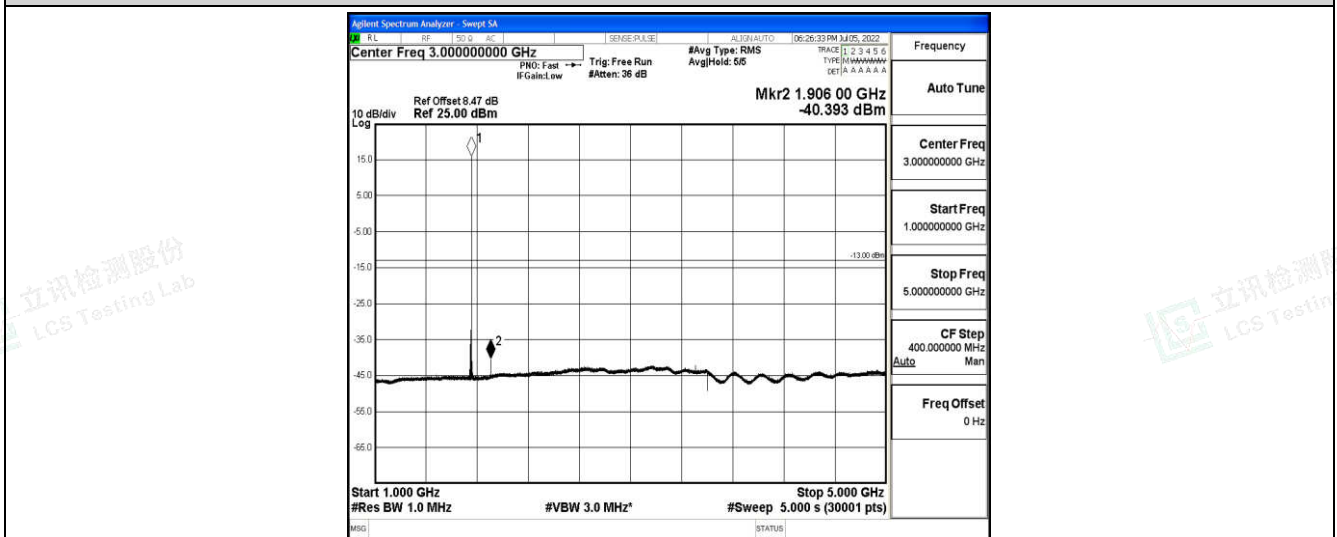


Band4-10MHz-QPSK-20350-1-0-High-1000-5000--40.39-PASS

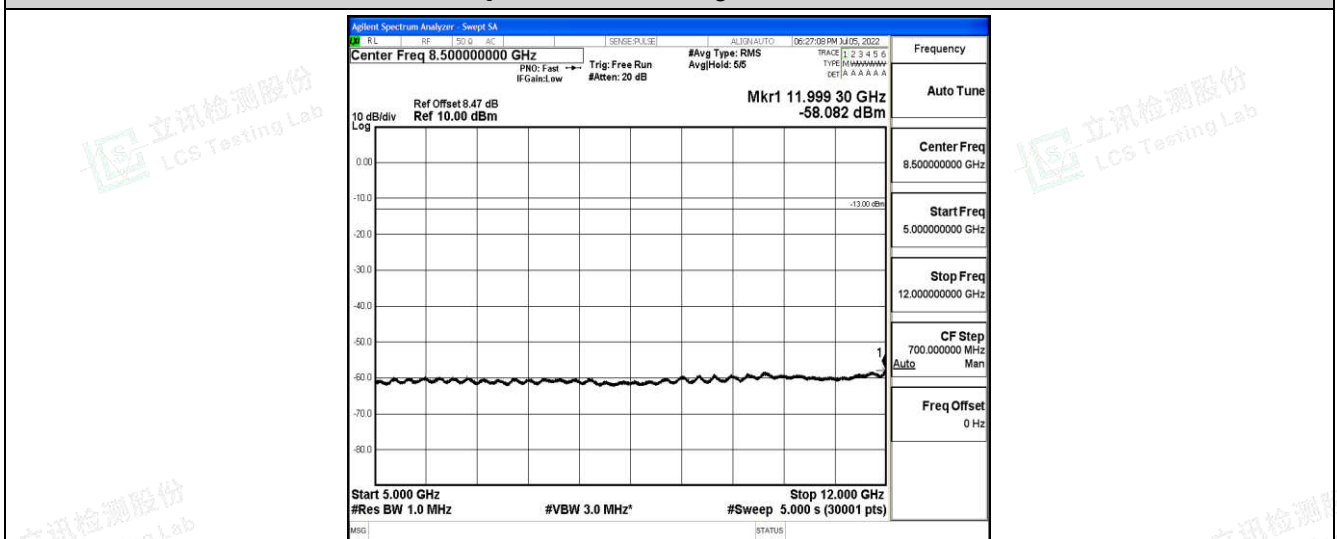


Band4-10MHz-QPSK-20350-1-0-High-5000-12000--58.08-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

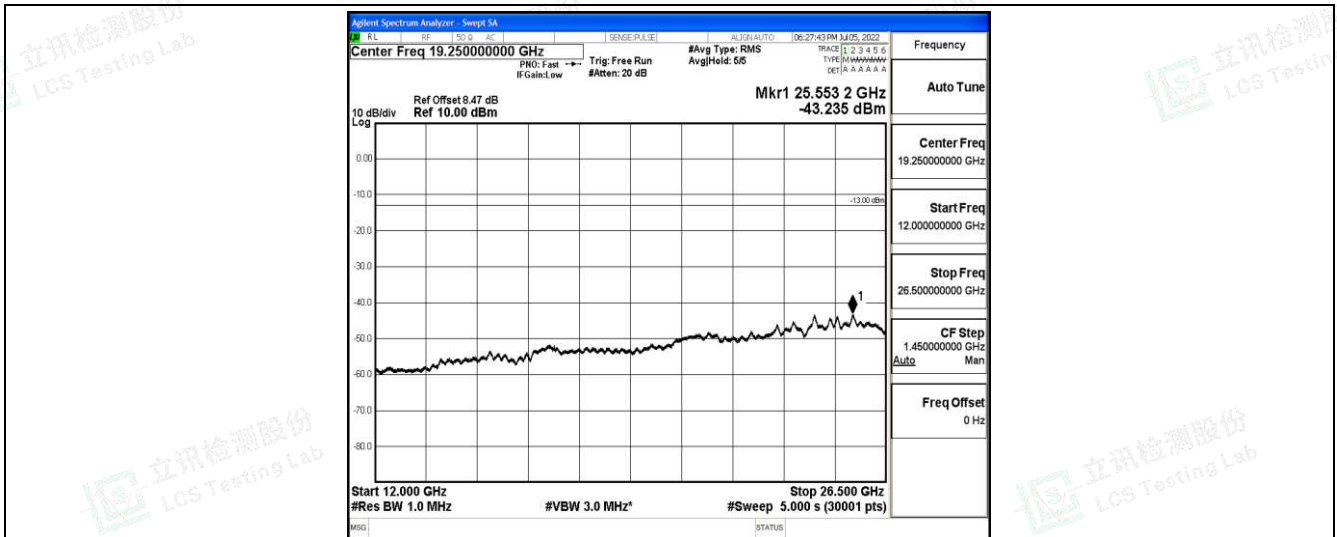

Band4-10MHz-QPSK-20350-1-0-High-12000-26500--43.24-PASS

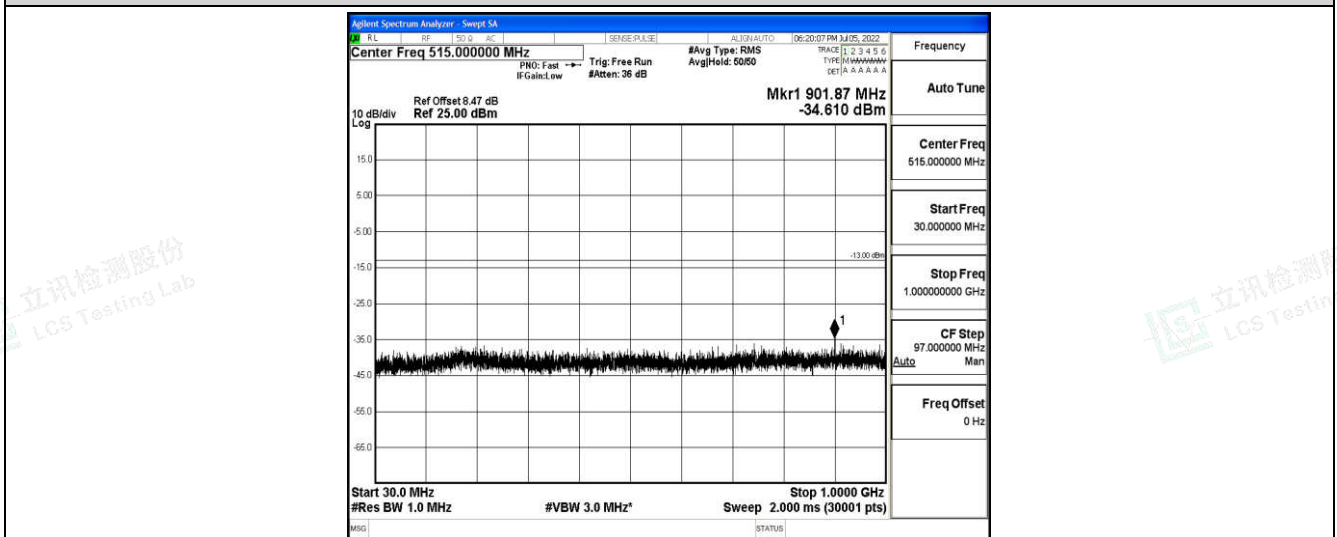


Band4-10MHz-16QAM-20000-1-0-Low-30-1000--34.61-PASS

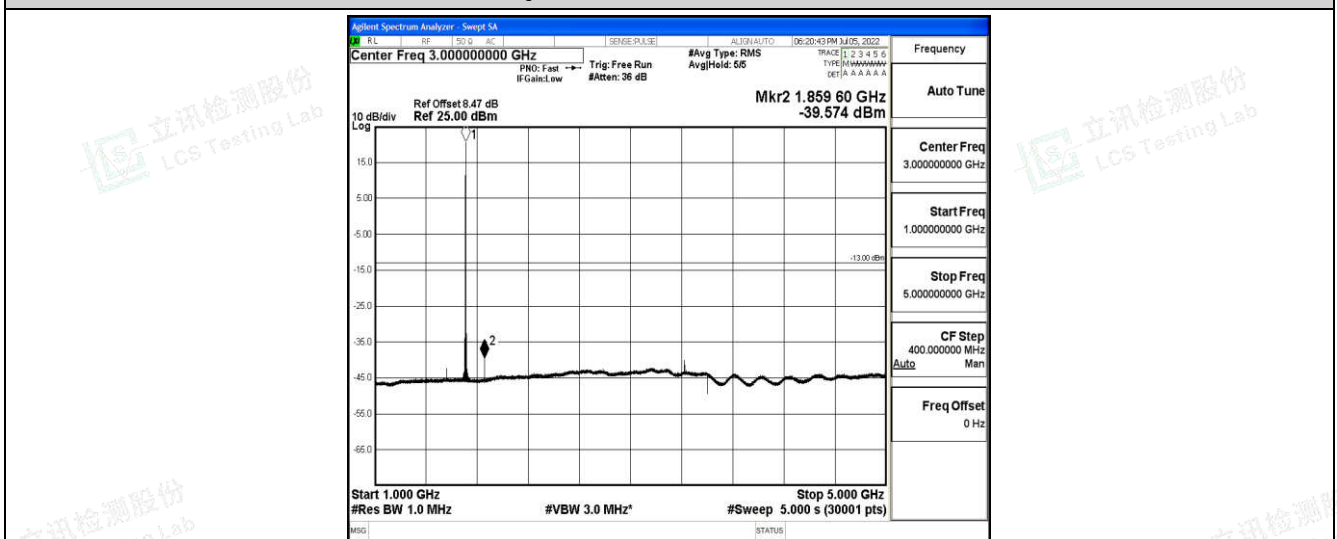


Band4-10MHz-16QAM-20000-1-0-Low-1000-5000--39.57-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

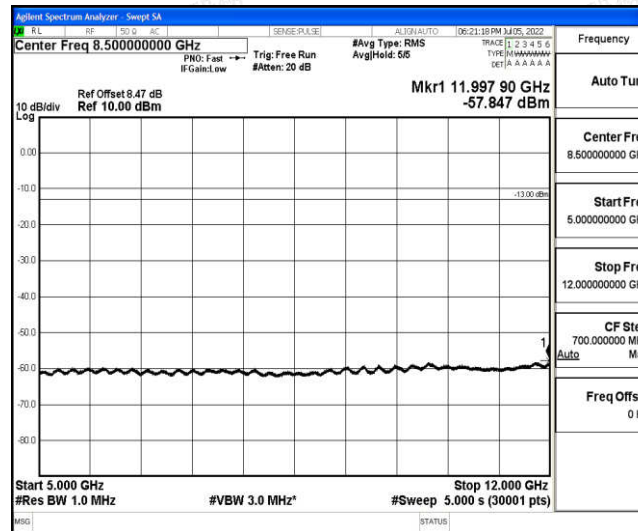

Band4-10MHz-16QAM-20000-1-0-Low-5000-12000--57.85-PASS

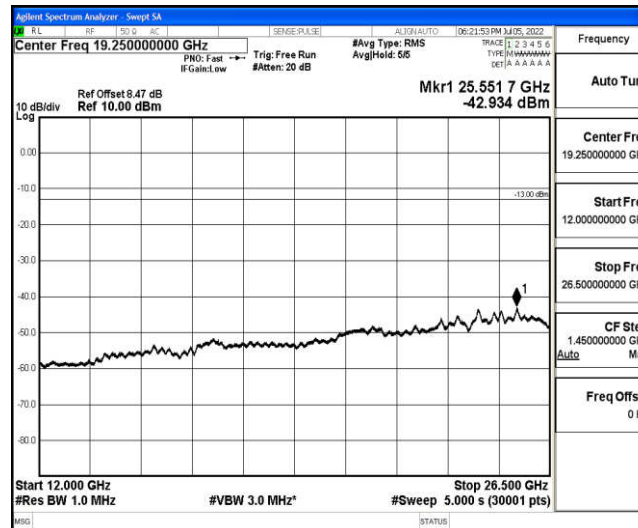

Band4-10MHz-16QAM-20000-1-0-Low-12000-26500--42.93-PASS

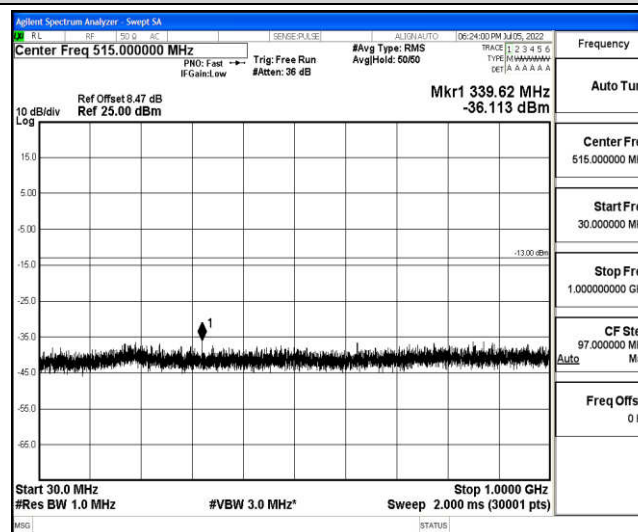

Band4-10MHz-16QAM-20175-1-0-Low-30-1000--36.11-PASS

