





11A_Ant0_High_5240_Peak

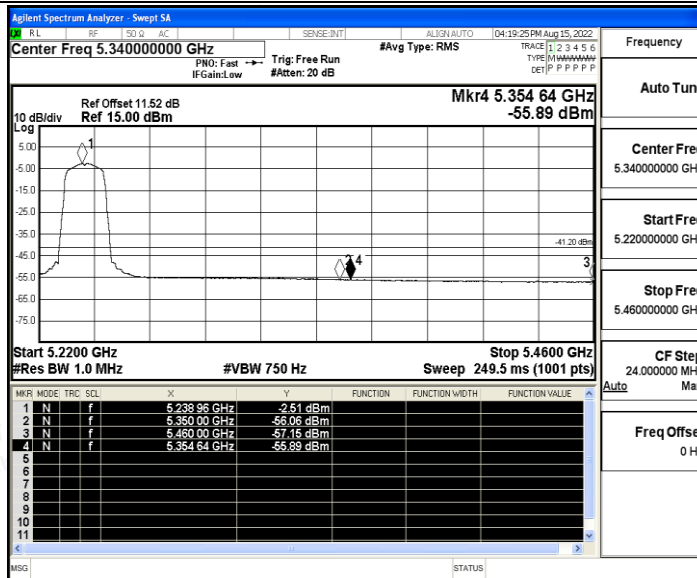

11N20SISO_Ant0_Low_5180_AV

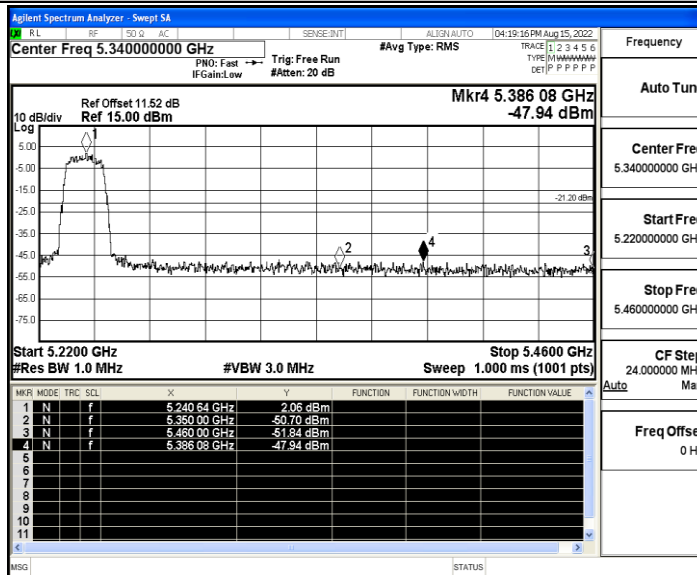


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

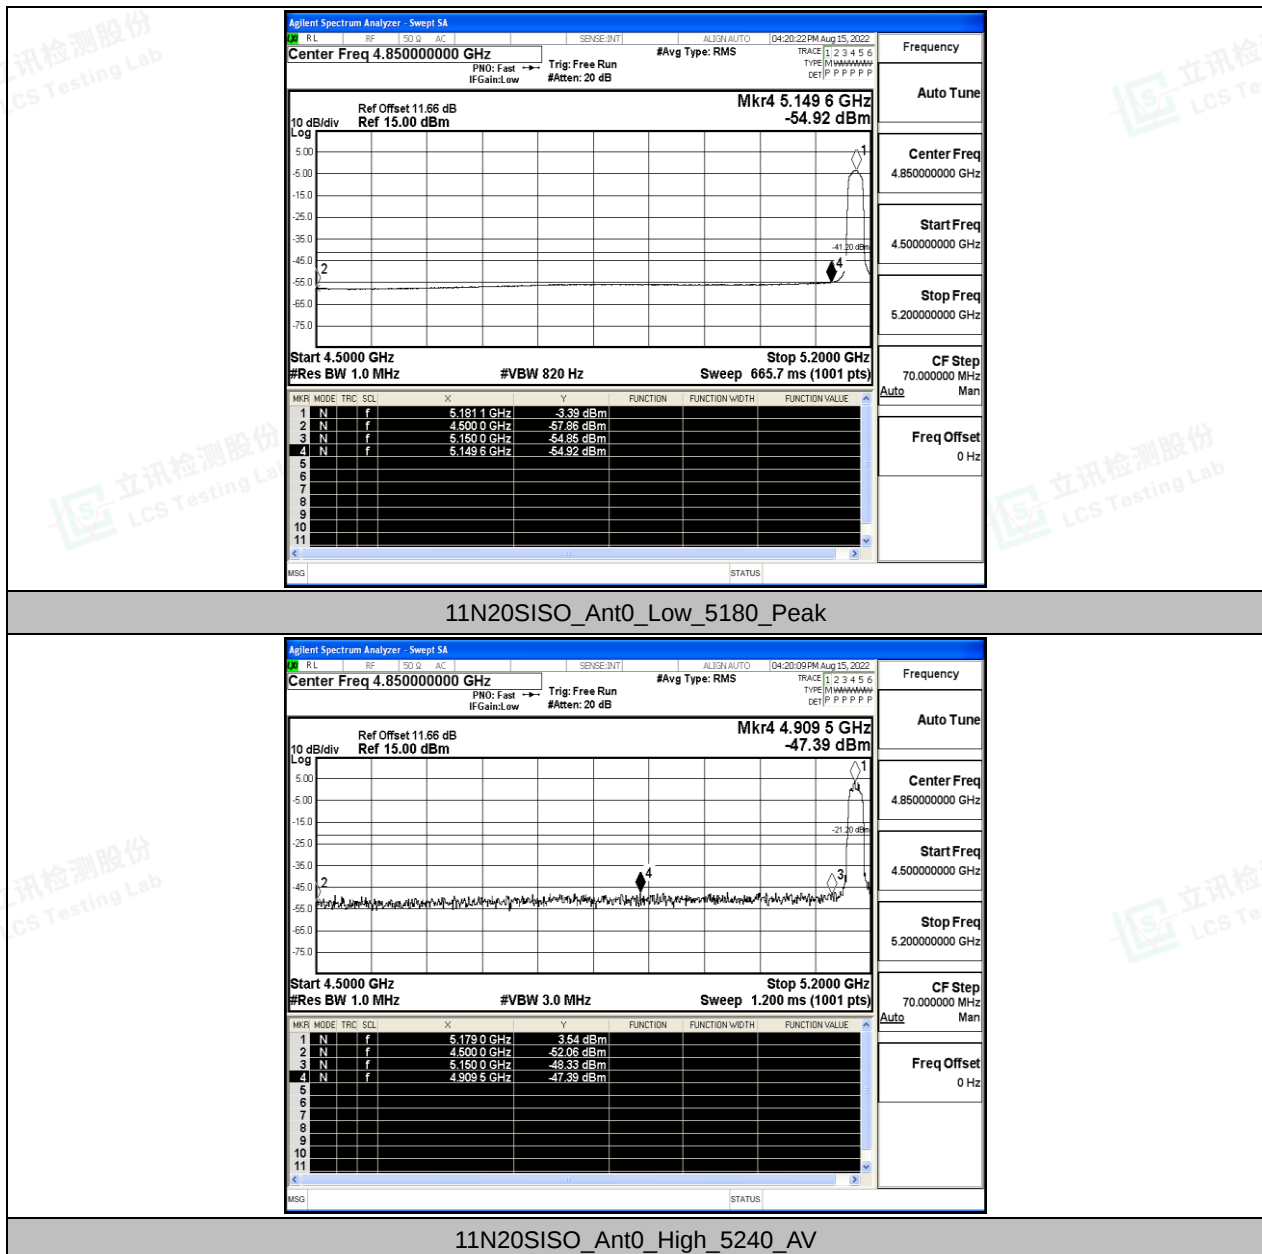


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

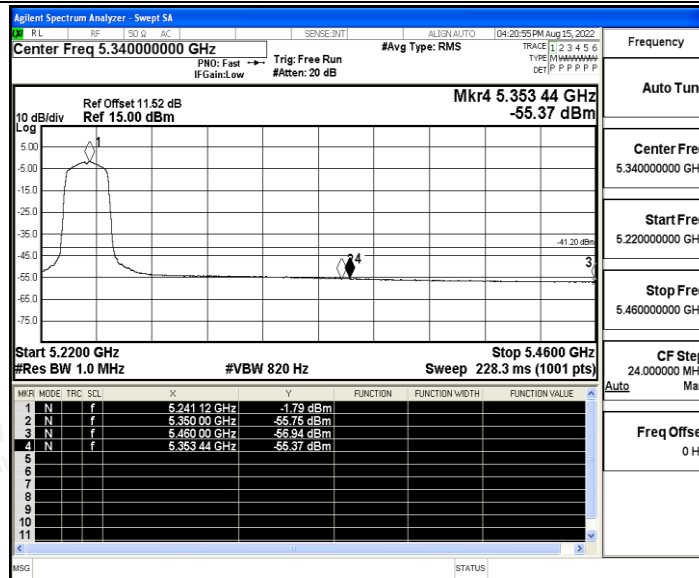

11N20SISO_Ant0_High_5240_Peak

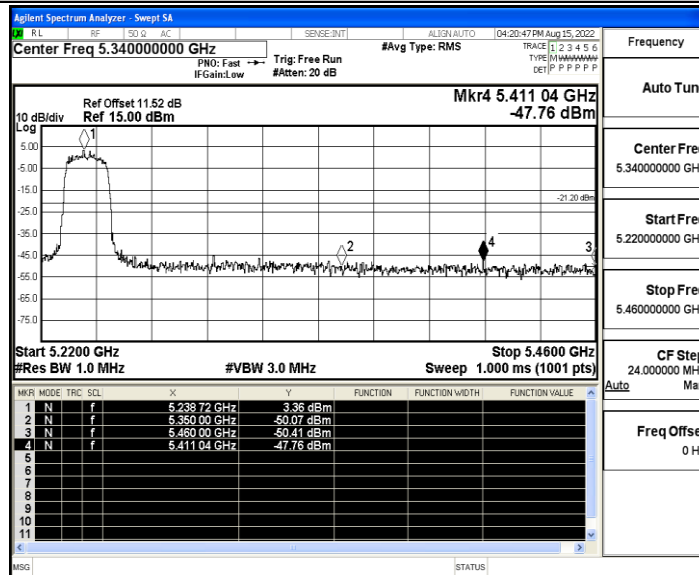

11N40SISO_Ant0_Low_5190_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

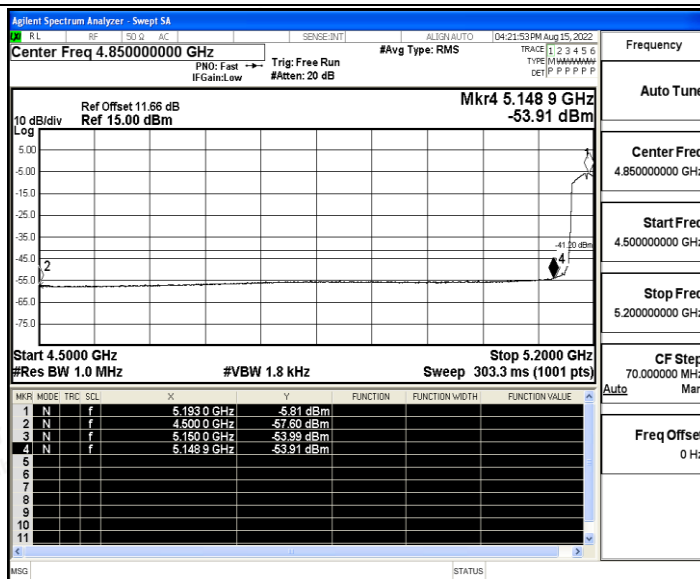

11N40SISO_Ant0_Low_5190_Peak

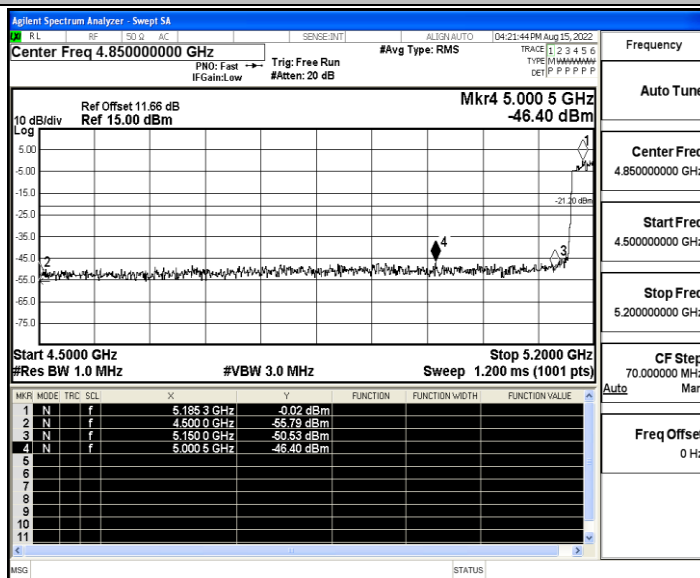

11N40SISO_Ant0_High_5230_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

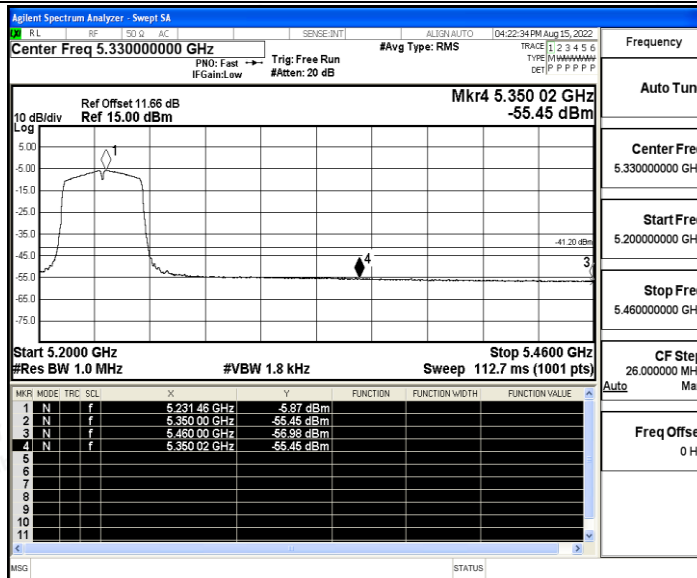

11N40SISO_Ant0_High_5230_Peak

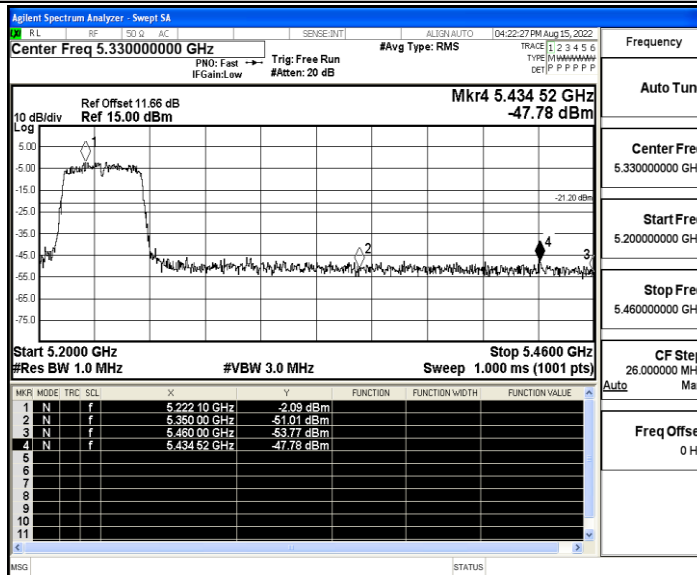

11AC20SISO_Ant0_Low_5180_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

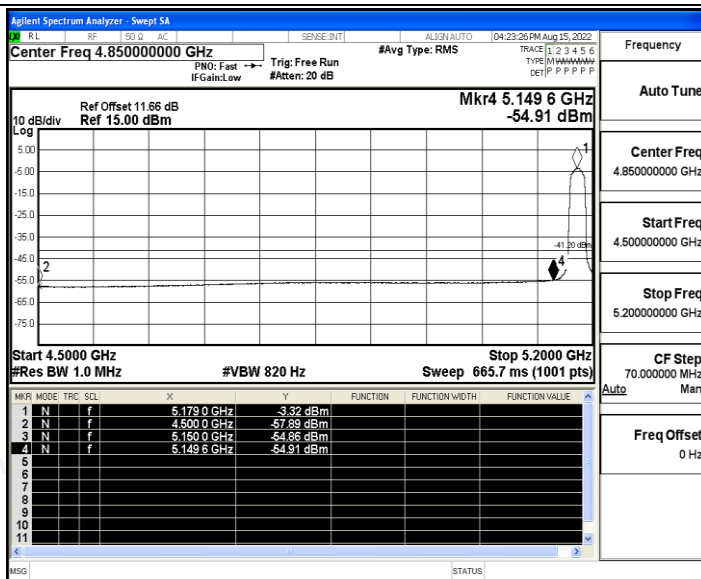

11AC20SISO_Ant0_Low_5180_Peak

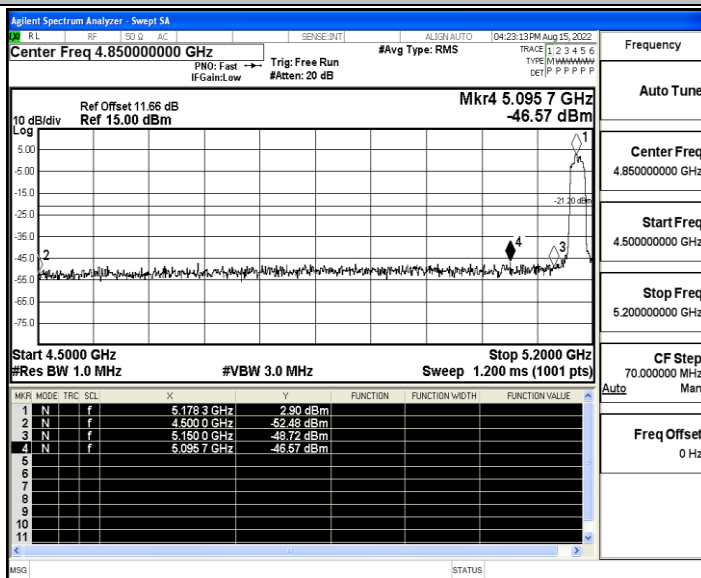

11AC20SISO_Ant0_High_5240_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

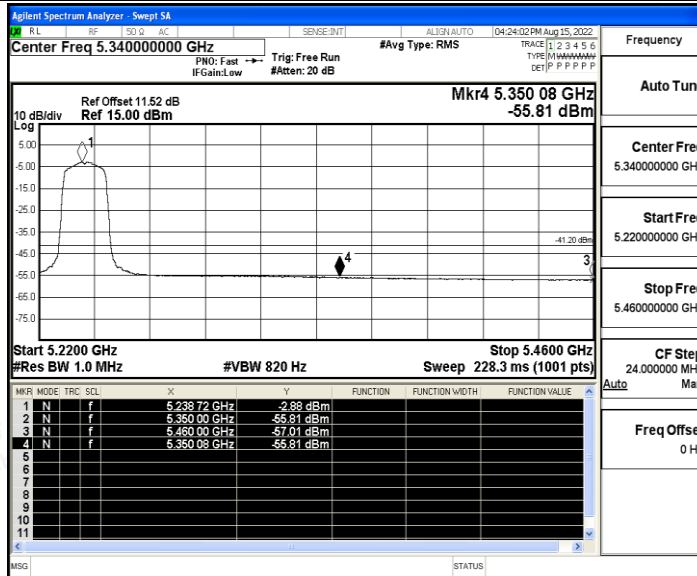

11AC20SISO_Ant0_High_5240_Peak

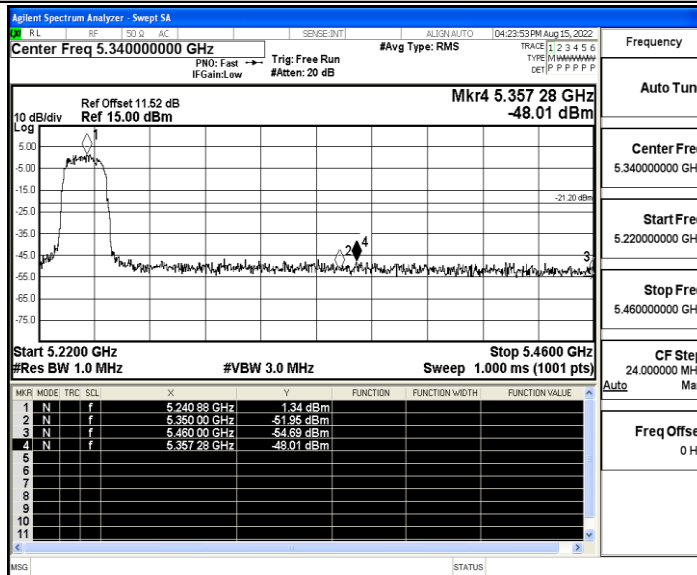

11AC40SISO_Ant0_Low_5190_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

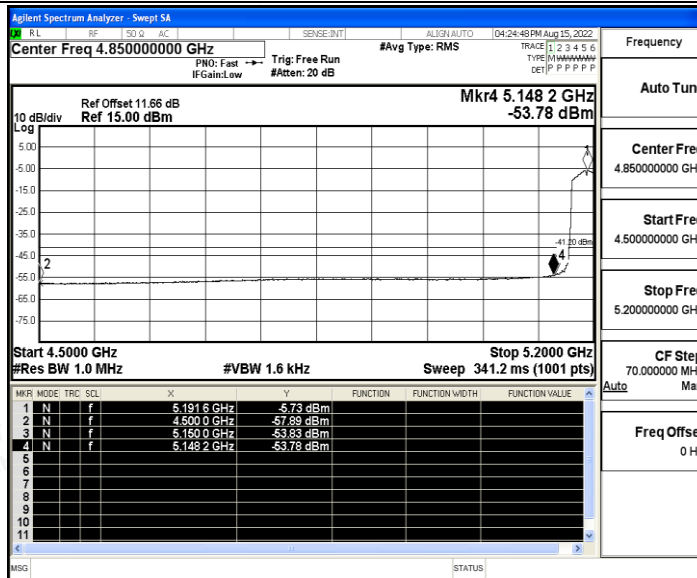

11AC40SISO_Ant0_Low_5190_Peak

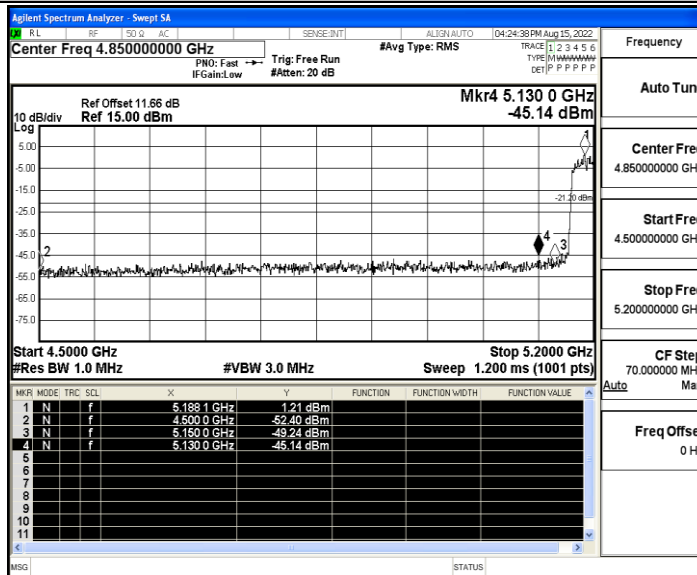

11AC40SISO_Ant0_High_5230_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

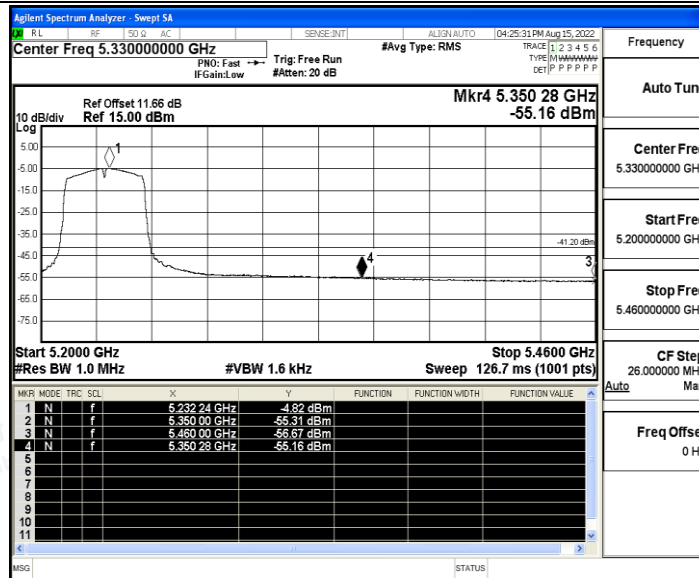

11AC40SISO_Ant0_High_5230_Peak

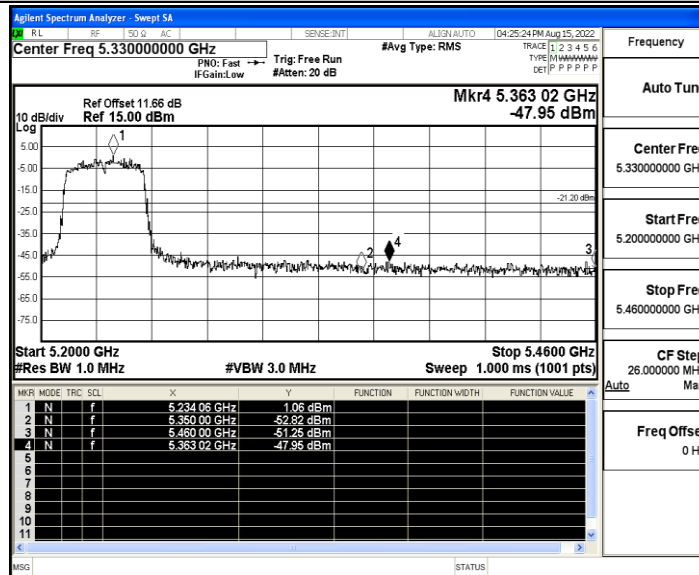

11AC80SISO_Ant0_Low_5210_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

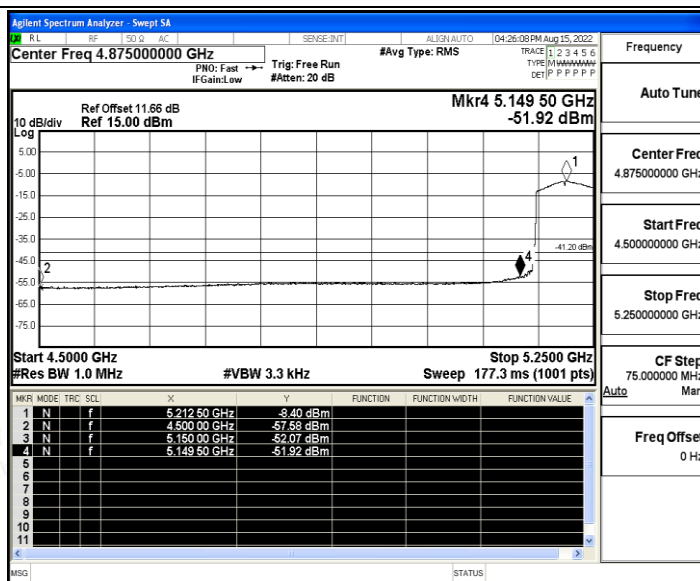

11AC80SISO_Ant0_Low_5210_Peak

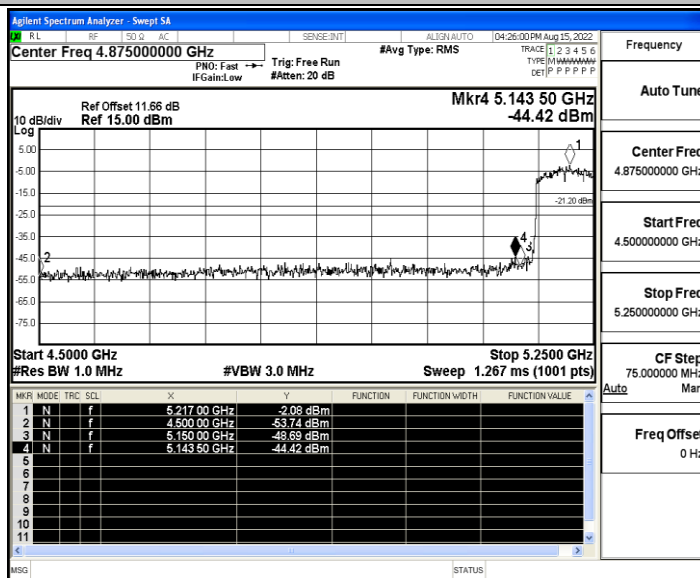

11AC80SISO_Ant0_High_5210_AV









Ant1

11A_Ant1_Low_5180_AV

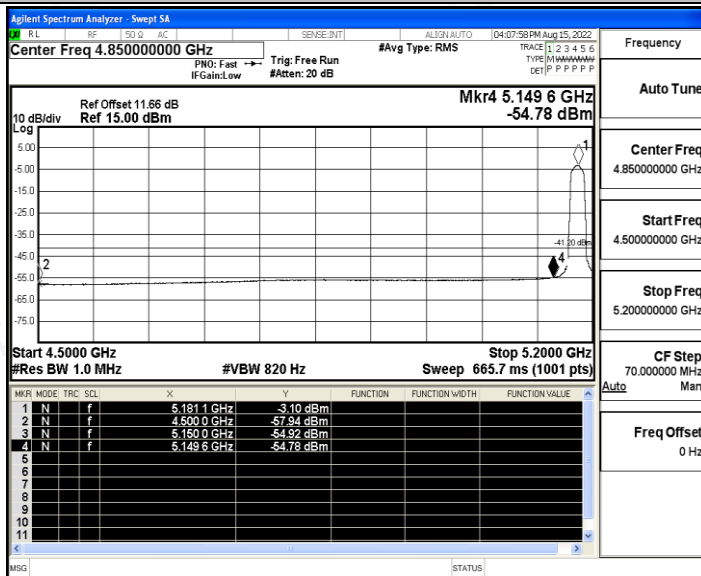


11A_Ant1_Low_5180_Peak

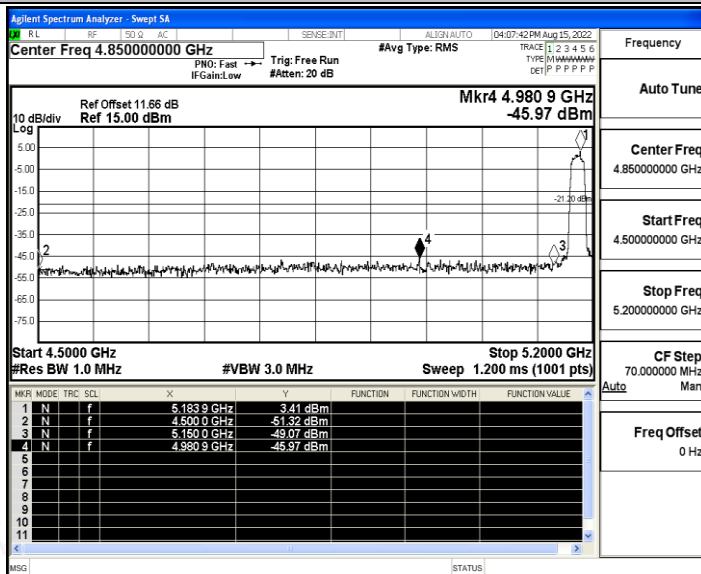


11A_Ant1_High_5240_AV



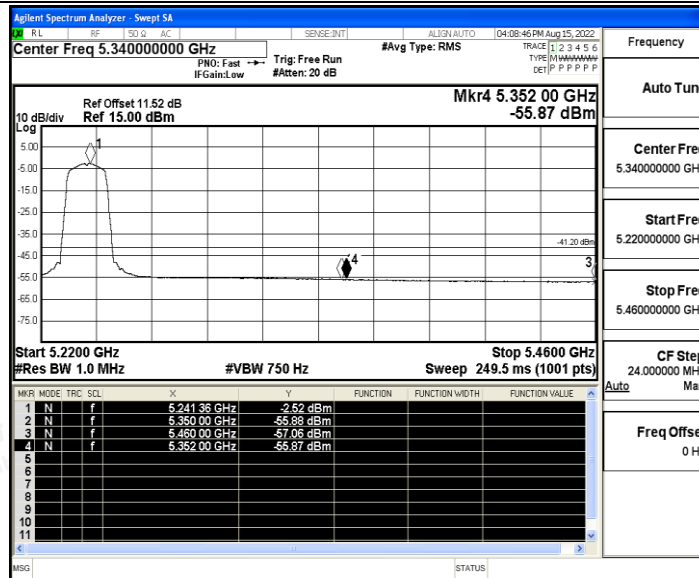


11A_Ant1_High_5240_Peak

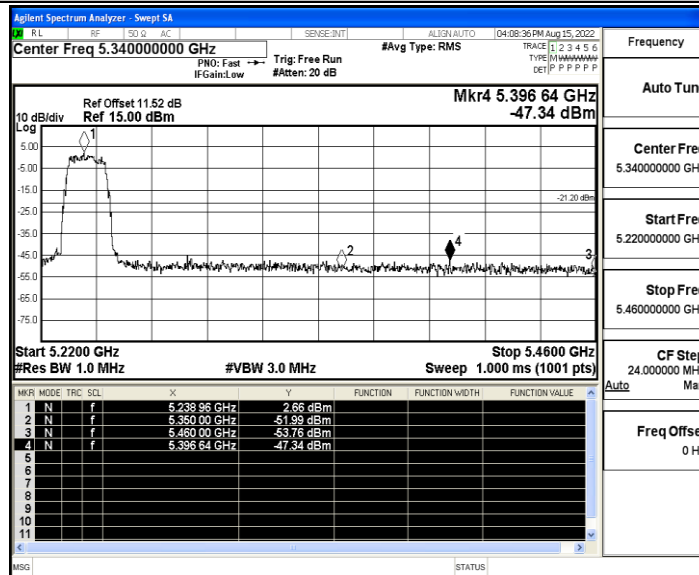


11N20SISO_Ant1_Low_5180_AV



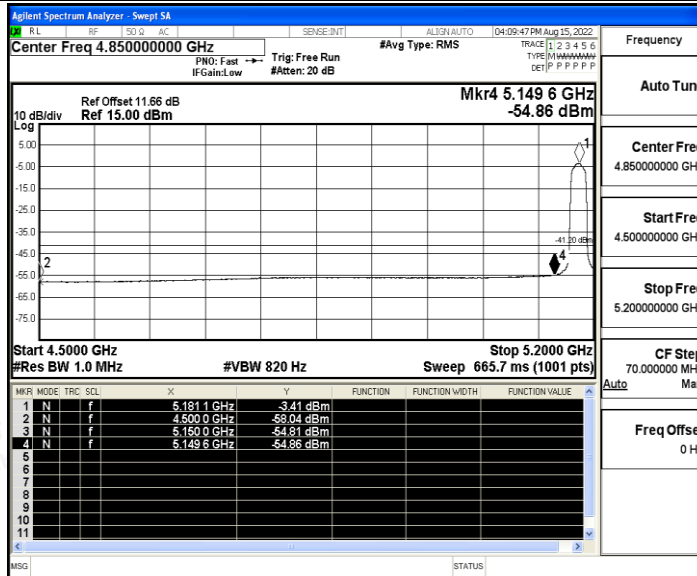

11N20SISO_Ant1_Low_5180_Peak

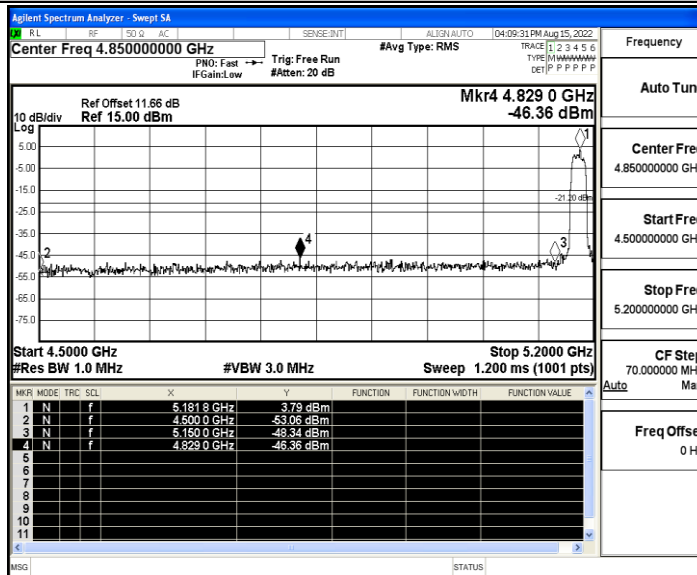

11N20SISO_Ant1_High_5240_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

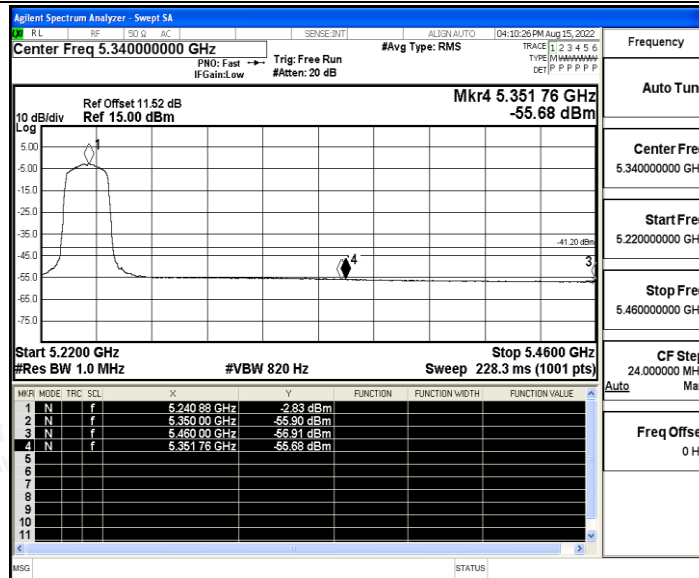

11N20SISO_Ant1_High_5240_Peak

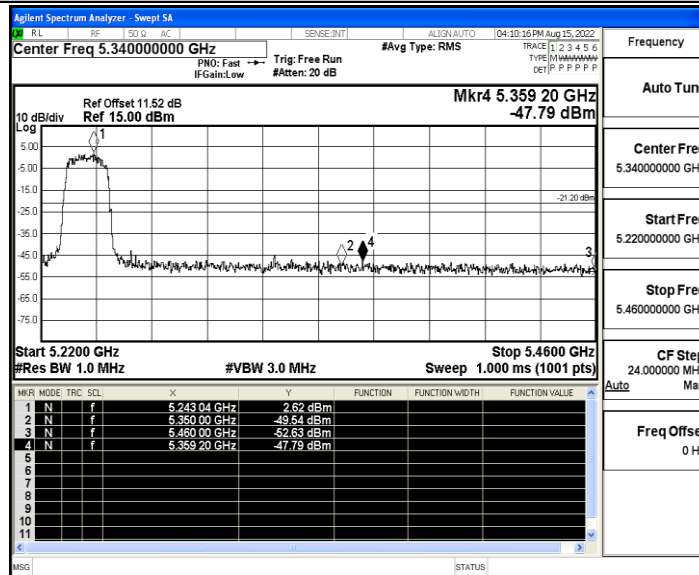

11N40SISO_Ant1_Low_5190_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

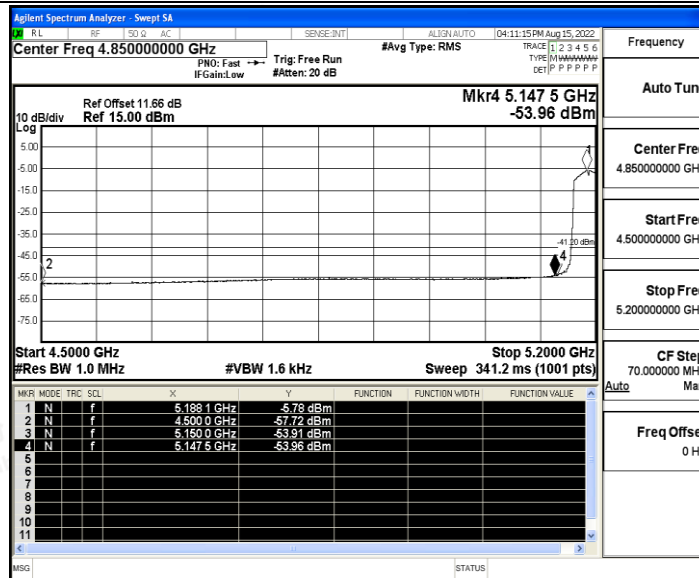

11N40SISO_Ant1_Low_5190_Peak

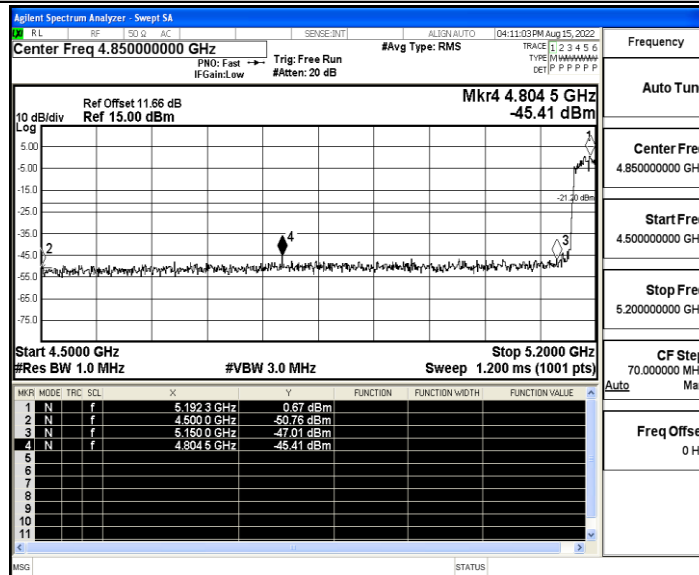

11N40SISO_Ant1_High_5230_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

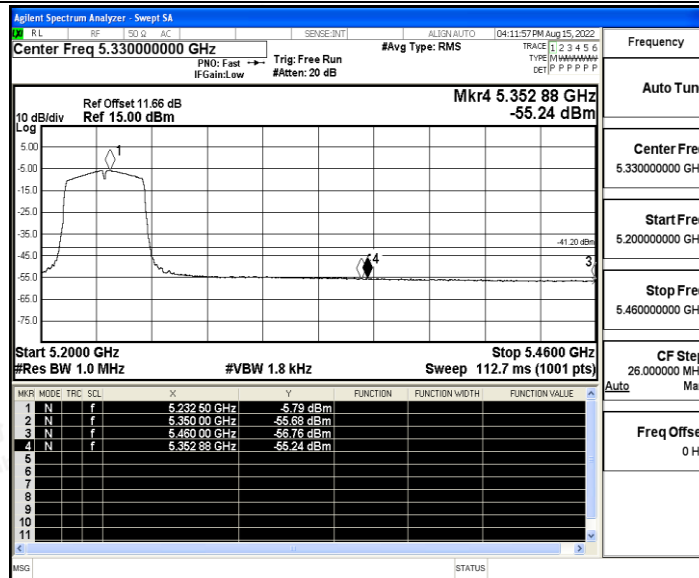

11N40SISO_Ant1_High_5230_Peak

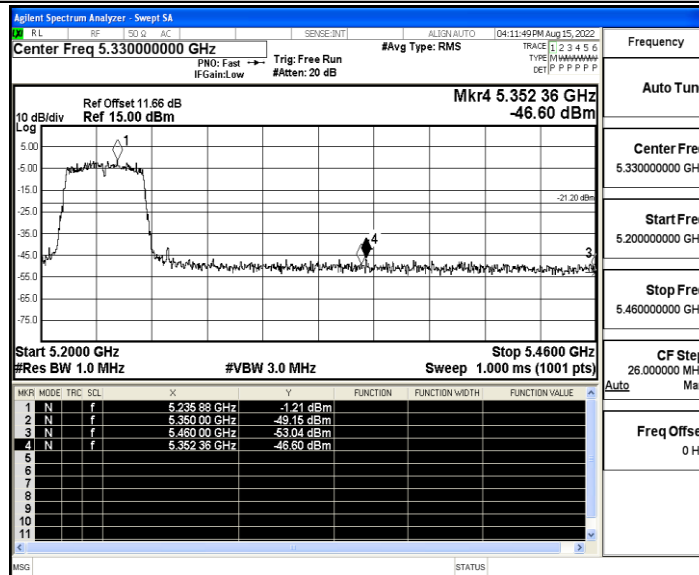

11AC20SISO_Ant1_Low_5180_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

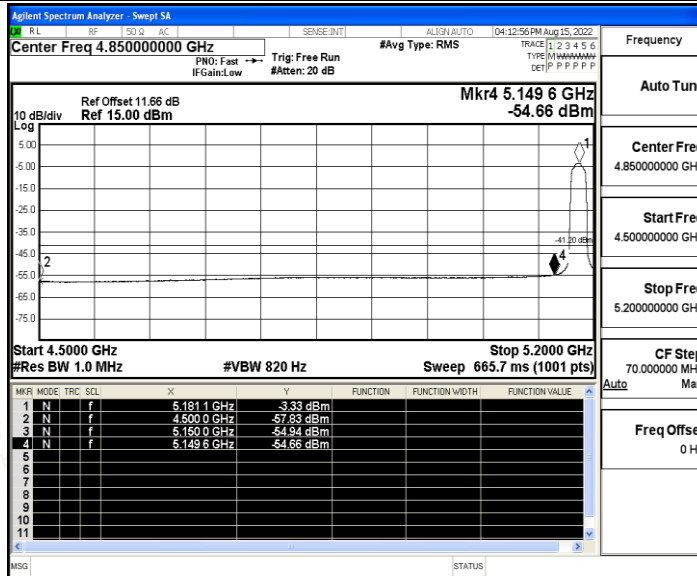

11AC20SISO_Ant1_Low_5180_Peak

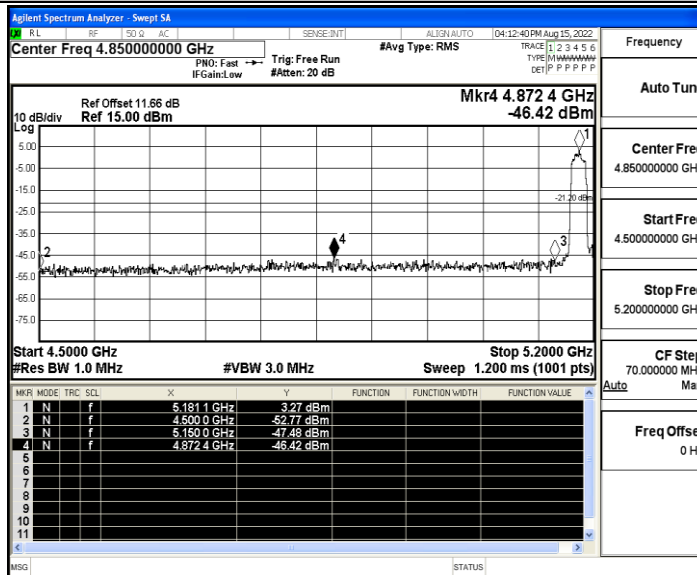

11AC20SISO_Ant1_High_5240_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

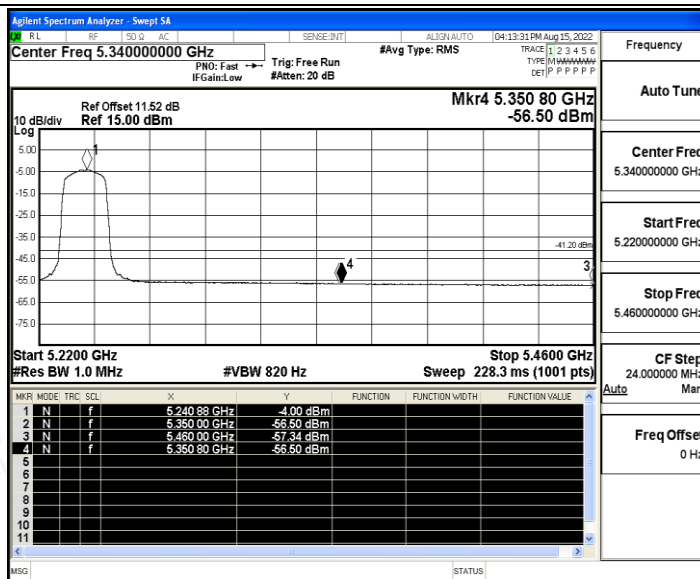


11AC20SISO_Ant1_High_5240_Peak

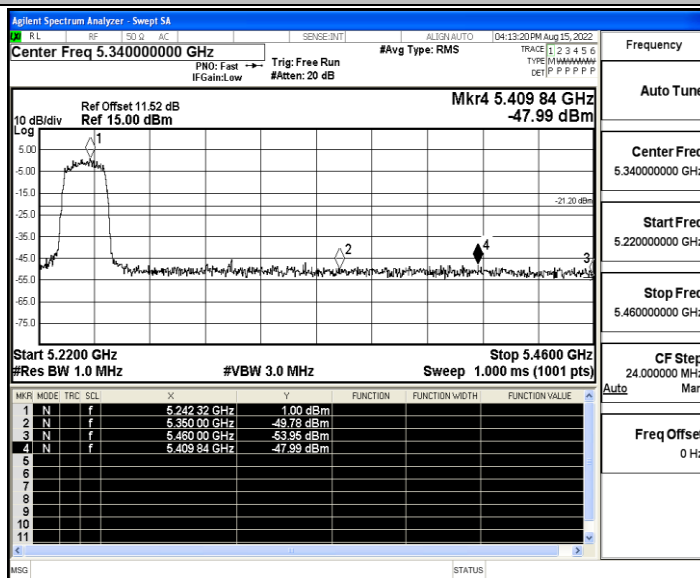


11AC40SISO_Ant1_Low_5190_AV



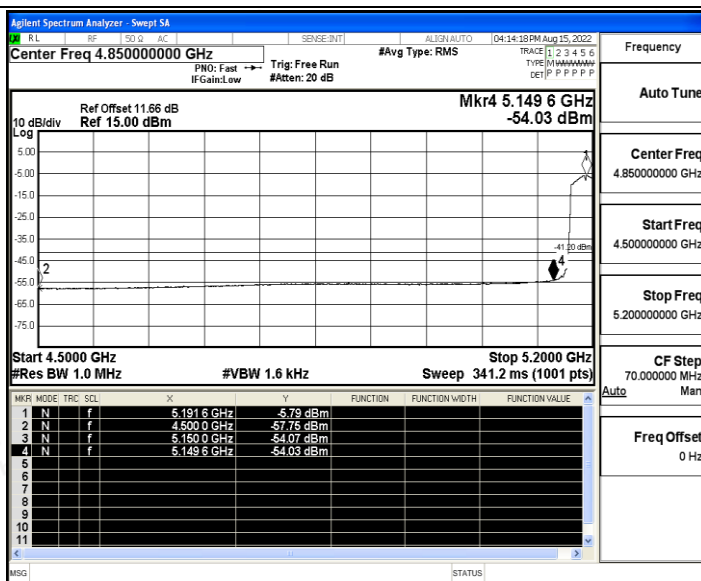

11AC40SISO_Ant1_Low_5190_Peak

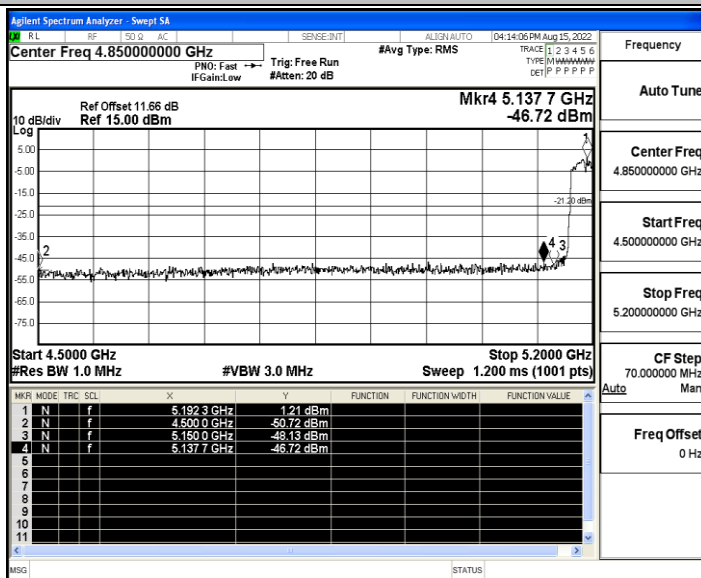

11AC40SISO_Ant1_High_5230_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

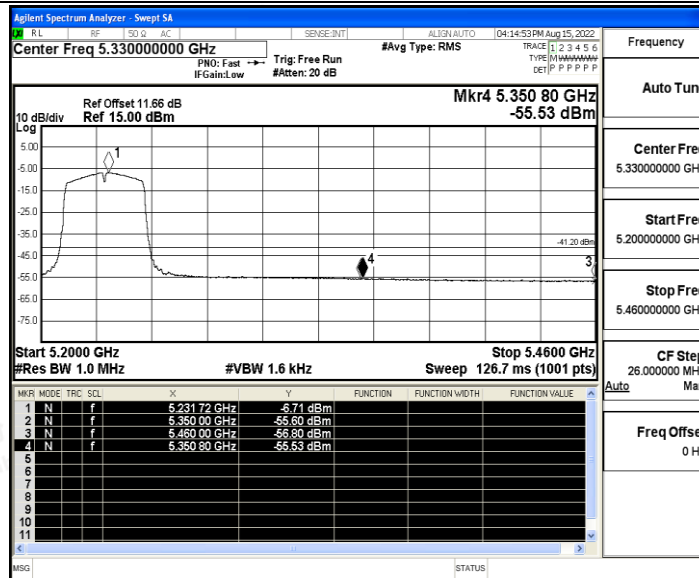

11AC40SISO_Ant1_High_5230_Peak

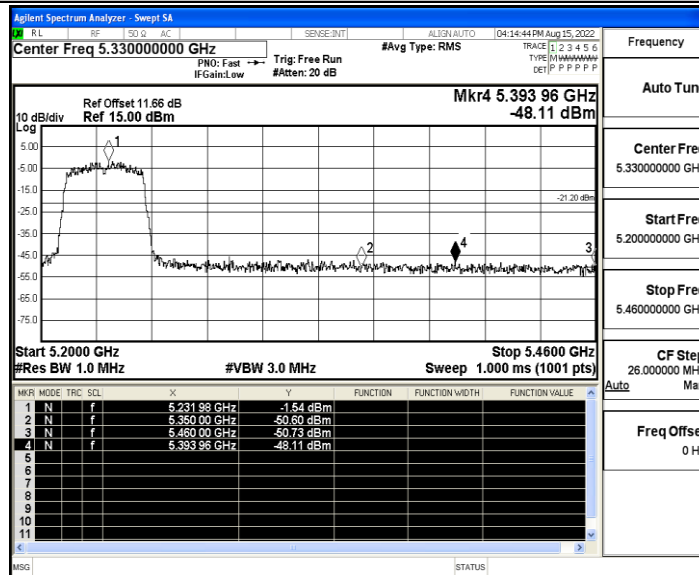

11AC80SISO_Ant1_Low_5210_AV




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

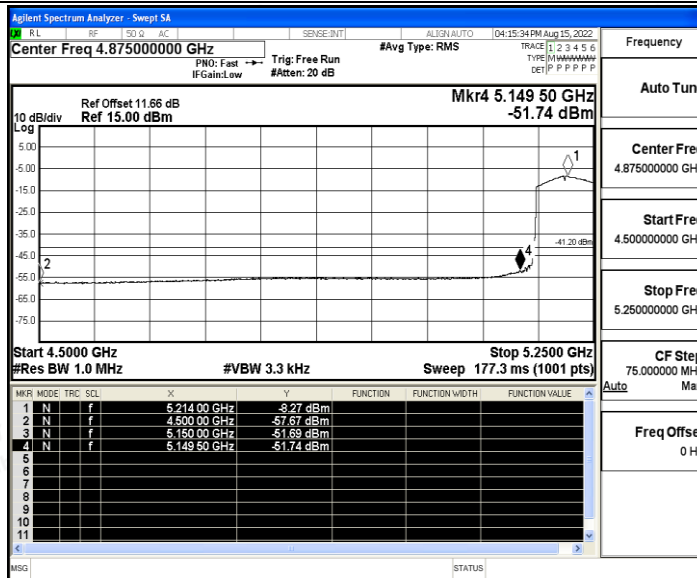

11AC80SISO_Ant1_Low_5210_Peak

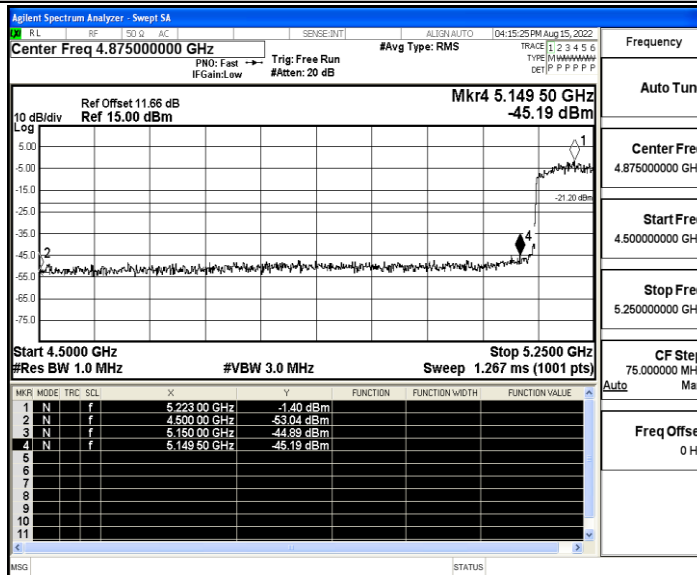

11AC80SISO_Ant1_High_5210_AV



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability

Test Result

Voltage								
TestMode	Antenna	Frequency [MHz]	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
11AC20SI SO	Ant0	5180	NV	NT	0	0	20	PASS
			LV	NT	20000	3.861004	20	PASS
			HV	NT	0	0	20	PASS
		5220	NV	NT	0	0	20	PASS
			LV	NT	20000	3.831418	20	PASS
			HV	NT	0	0	20	PASS
		5240	NV	NT	0	0	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	0	0	20	PASS
11AC40SI SO	Ant0	5190	NV	NT	-40000	-7.707129	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	0	0	20	PASS
		5230	NV	NT	40000	7.648184	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	0	0	20	PASS
11AC80SI SO	Ant0	5210	NV	NT	0	0	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	0	0	20	PASS

Temperature								
TestMode	Antenna	Frequency [MHz]	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
11AC20SI SO	Ant0	5180	NV	-30	20000	3.861004	20	PASS
			NV	-20	20000	3.861004	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	20000	3.861004	20	PASS
			NV	40	0	0	20	PASS
			NV	50	0	0	20	PASS
		5220	NV	-30	0	0	20	PASS
			NV	-20	0	0	20	PASS
			NV	-10	20000	3.831418	20	PASS
			NV	0	20000	3.831418	20	PASS
			NV	0	20000	3.831418	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	0	0	20	PASS
			NV	40	0	0	20	PASS
			NV	50	20000	3.831418	20	PASS
		5240	NV	-30	0	0	20	PASS
			NV	-20	-20000	-3.816794	20	PASS
			NV	-10	20000	3.816794	20	PASS
			NV	0	0	0	20	PASS
			NV	10	20000	3.816794	20	PASS
			NV	20	20000	3.816794	20	PASS
			NV	30	0	0	20	PASS
			NV	40	0	0	20	PASS
			NV	50	20000	3.816794	20	PASS
11AC40SI SO	Ant0	5190	NV	-30	0	0	20	PASS
			NV	-20	40000	7.707129	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	0	0	20	PASS
			NV	40	-40000	-7.707129	20	PASS
			NV	50	40000	7.707129	20	PASS
		5230	NV	-30	0	0	20	PASS
			NV	-20	0	0	20	PASS
			NV	-10	40000	7.648184	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	40000	7.648184	20	PASS
			NV	30	40000	7.648184	20	PASS
			NV	40	0	0	20	PASS
			NV	50	-40000	-7.648184	20	PASS
11AC80SI SO	Ant0	5210	NV	-30	0	0	20	PASS
			NV	-20	-80000	-15.355086	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	-80000	-15.355086	20	PASS
			NV	30	0	0	20	PASS
			NV	40	0	0	20	PASS
			NV	50	0	0	20	PASS
			NV	50	0	0	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Voltage								
TestMode	Antenna	Frequency [MHz]	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
11AC20SI SO	Ant1	5180	NV	NT	-20000	-3.861004	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	20000	3.861004	20	PASS
		5220	NV	NT	0	0	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	0	0	20	PASS
		5240	NV	NT	0	0	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	20000	3.816794	20	PASS
11AC40SI SO	Ant1	5190	NV	NT	0	0	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	-40000	-7.707129	20	PASS
		5230	NV	NT	0	0	20	PASS
			LV	NT	40000	7.648184	20	PASS
			HV	NT	40000	7.648184	20	PASS
11AC80SI SO	Ant1	5210	NV	NT	0	0	20	PASS
			LV	NT	0	0	20	PASS
			HV	NT	0	0	20	PASS

Temperature								
TestMode	Antenna	Frequency [MHz]	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
11AC20SI SO	Ant1	5180	NV	-30	0	0	20	PASS
			NV	-20	20000	3.861004	20	PASS
			NV	-10	20000	3.861004	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	20000	3.861004	20	PASS
			NV	30	0	0	20	PASS
			NV	40	0	0	20	PASS
			NV	50	0	0	20	PASS
		5220	NV	-30	20000	3.831418	20	PASS
			NV	-20	20000	3.831418	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



			NV	20	20000	3.831418	20	PASS
			NV	30	0	0	20	PASS
			NV	40	20000	3.831418	20	PASS
			NV	50	20000	3.831418	20	PASS
		5240	NV	-30	0	0	20	PASS
			NV	-20	20000	3.816794	20	PASS
			NV	-10	0	0	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	0	0	20	PASS
			NV	40	0	0	20	PASS
			NV	50	0	0	20	PASS
			NV	-30	0	0	20	PASS
			NV	-20	0	0	20	PASS
			NV	-10	40000	7.707129	20	PASS
			NV	0	40000	7.707129	20	PASS
11AC40SI SO	Ant1	5190	NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	40000	7.707129	20	PASS
			NV	40	40000	7.707129	20	PASS
			NV	50	40000	7.707129	20	PASS
			NV	-30	0	0	20	PASS
			NV	-20	40000	7.648184	20	PASS
			NV	-10	0	0	20	PASS
		5230	NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	0	0	20	PASS
			NV	40	40000	7.648184	20	PASS
			NV	50	0	0	20	PASS
			NV	-30	0	0	20	PASS
			NV	-20	0	0	20	PASS
11AC80SI SO	Ant1	5210	NV	-10	0	0	20	PASS
			NV	0	0	0	20	PASS
			NV	10	0	0	20	PASS
			NV	20	0	0	20	PASS
			NV	30	0	0	20	PASS
			NV	40	0	0	20	PASS
			NV	50	-80000	-15.355086	20	PASS
			NV	-30	0	0	20	PASS
			NV	-20	0	0	20	PASS
			NV	-10	0	0	20	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.6 Duty Cycle

Test Result


TestMode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Factor	1/T
11A	Ant0	5180	1.40	1.50	93.33	0.30	0.71
		5220	1.40	1.50	93.33	0.30	0.71
		5240	1.40	1.50	93.33	0.30	0.71
11N20SISO	Ant0	5180	1.30	1.40	92.86	0.32	0.77
		5220	1.31	1.41	92.91	0.32	0.76
		5240	1.31	1.41	92.91	0.32	0.76
11N40SISO	Ant0	5190	0.64	0.74	86.49	0.63	1.56
		5230	0.64	0.74	86.49	0.63	1.56
11AC20SISO	Ant0	5180	1.32	1.42	92.96	0.32	0.76
		5220	1.32	1.42	92.96	0.32	0.76
		5240	1.31	1.41	92.91	0.32	0.76
11AC40SISO	Ant0	5190	0.66	0.76	86.84	0.61	1.52
		5230	0.66	0.76	86.84	0.61	1.52
11AC80SISO	Ant0	5210	0.32	0.42	76.19	1.18	3.13






Test Graphs

11A_Ant0_5180

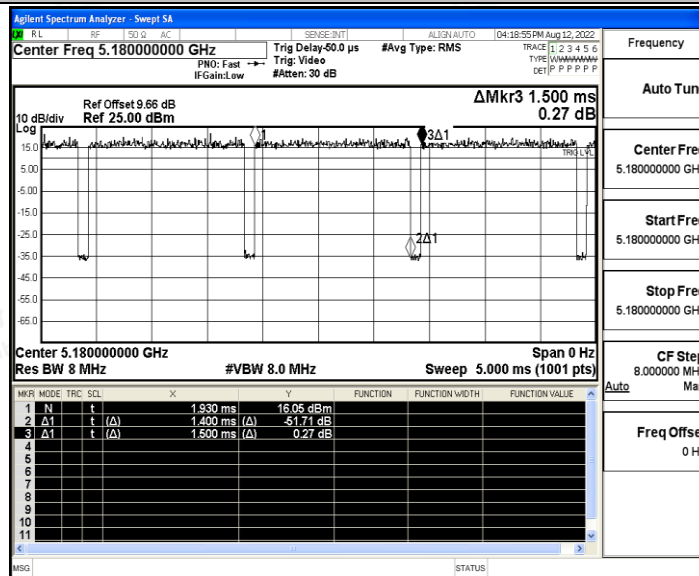


11A_Ant0_5220

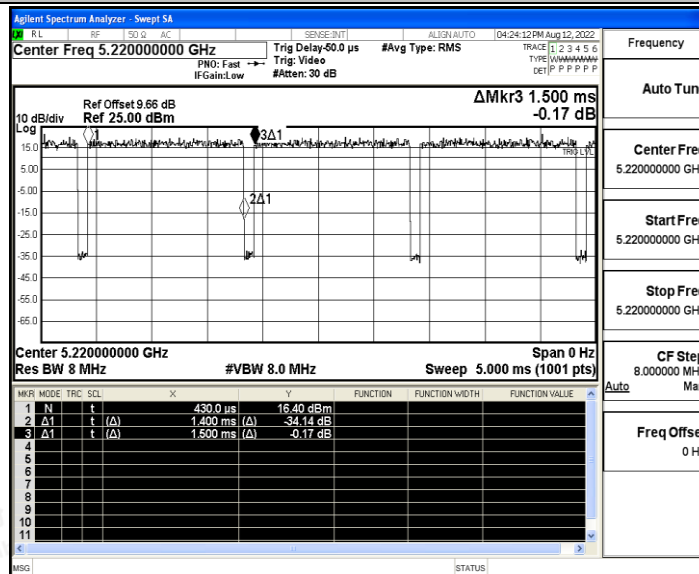


11A_Ant0_5240



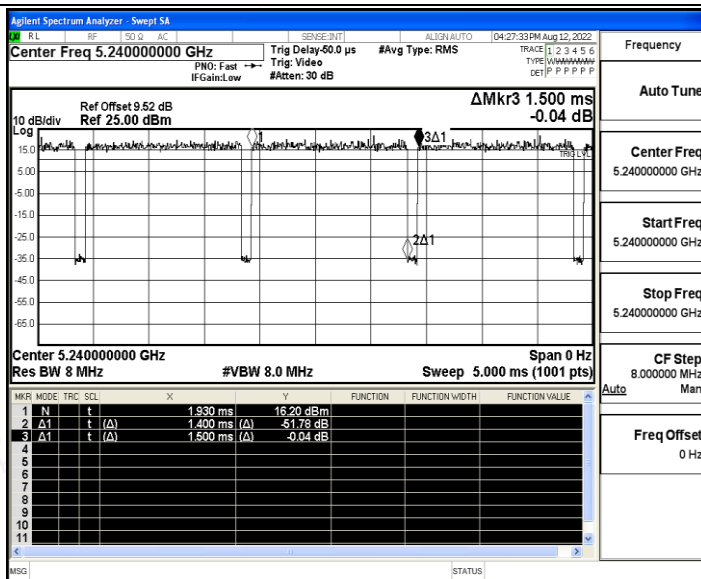

11N20SISO_Ant0_5180

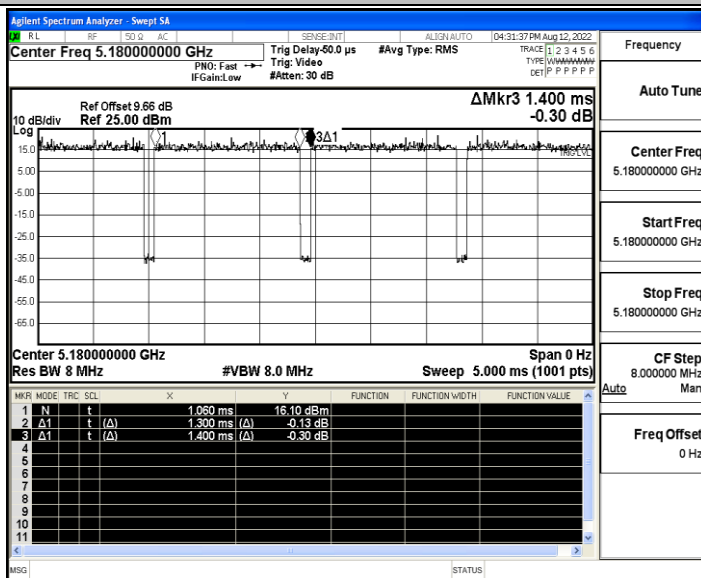

11N20SISO_Ant0_5220




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

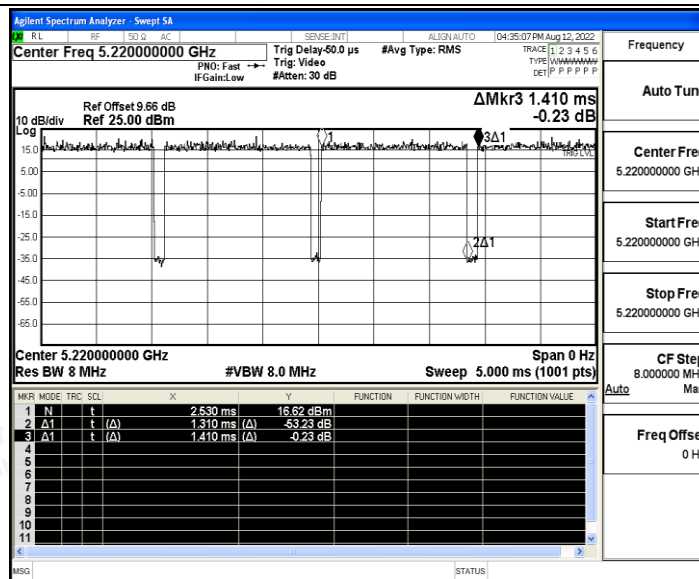

11N20SISO_Ant0_5240

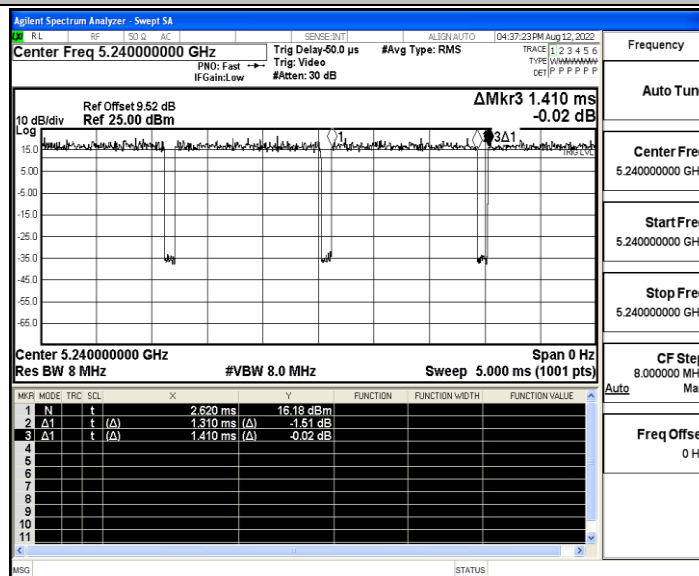

11N40SISO_Ant0_5190




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

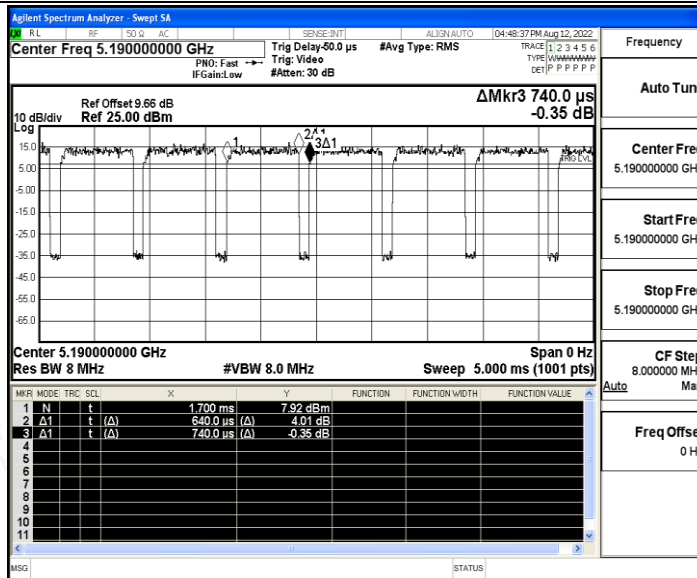


11N40SISO_Ant0_5230

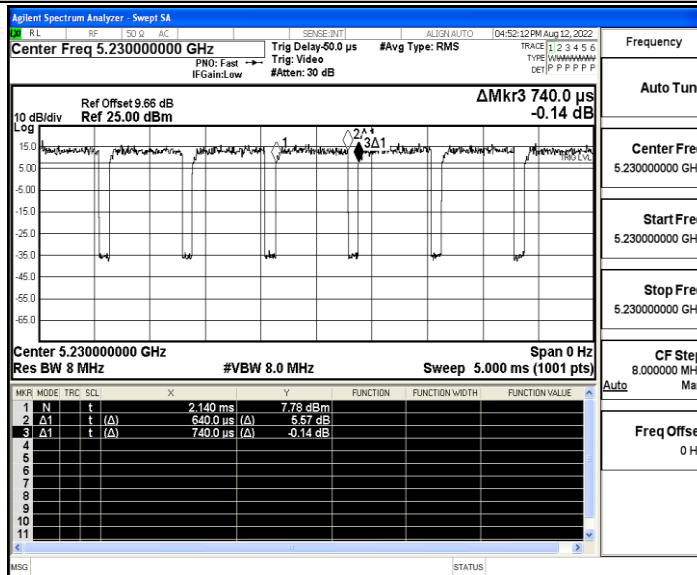


11AC20SISO_Ant0_5180



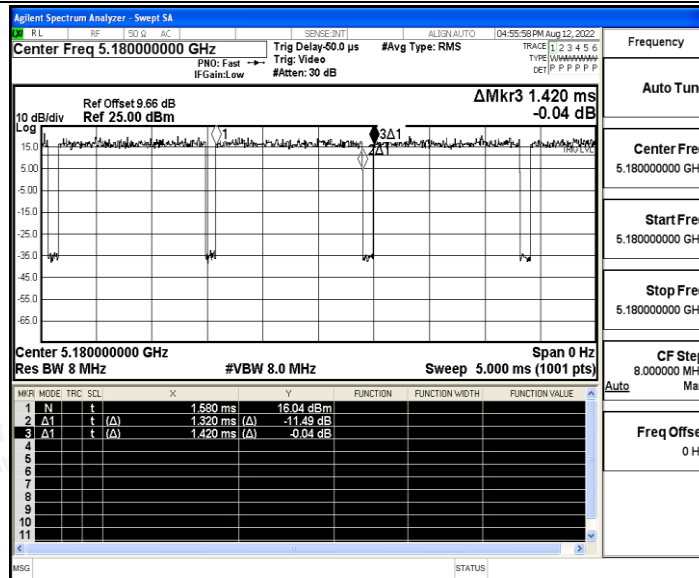

11AC20SISO_Ant0_5220

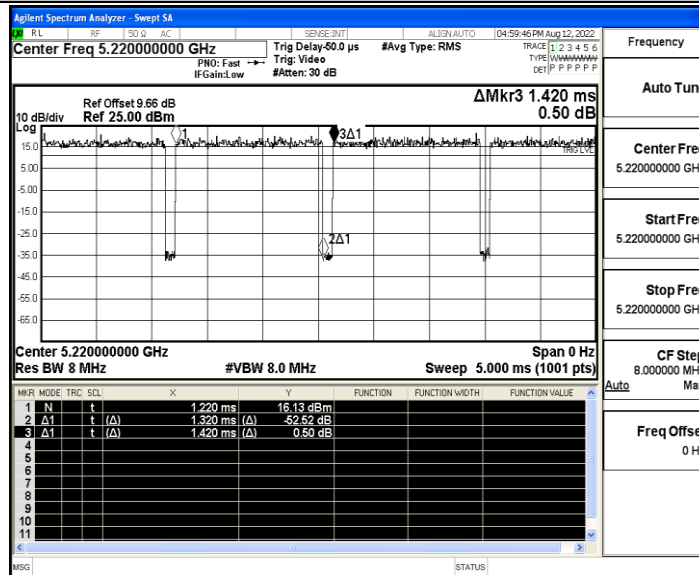

11AC20SISO_Ant0_5240




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

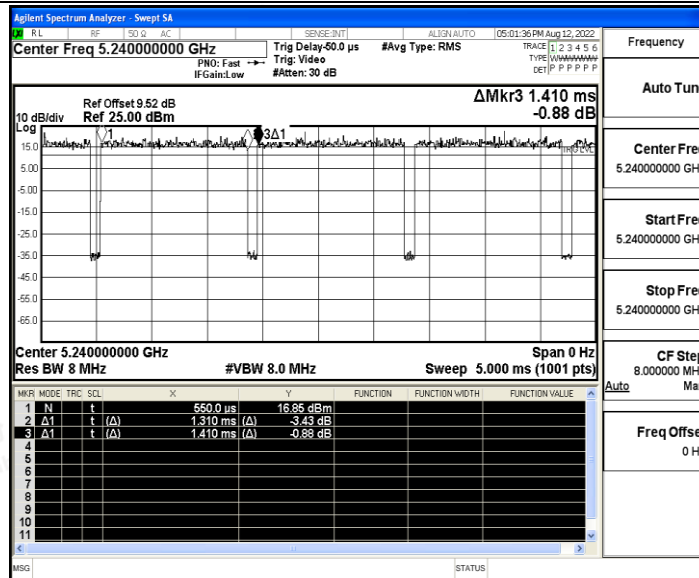

11AC40SISO_Ant0_5190

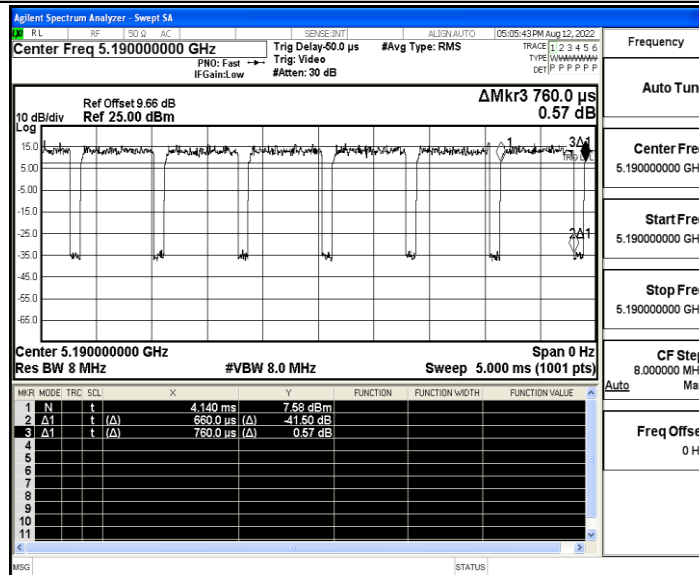

11AC40SISO_Ant0_5230




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

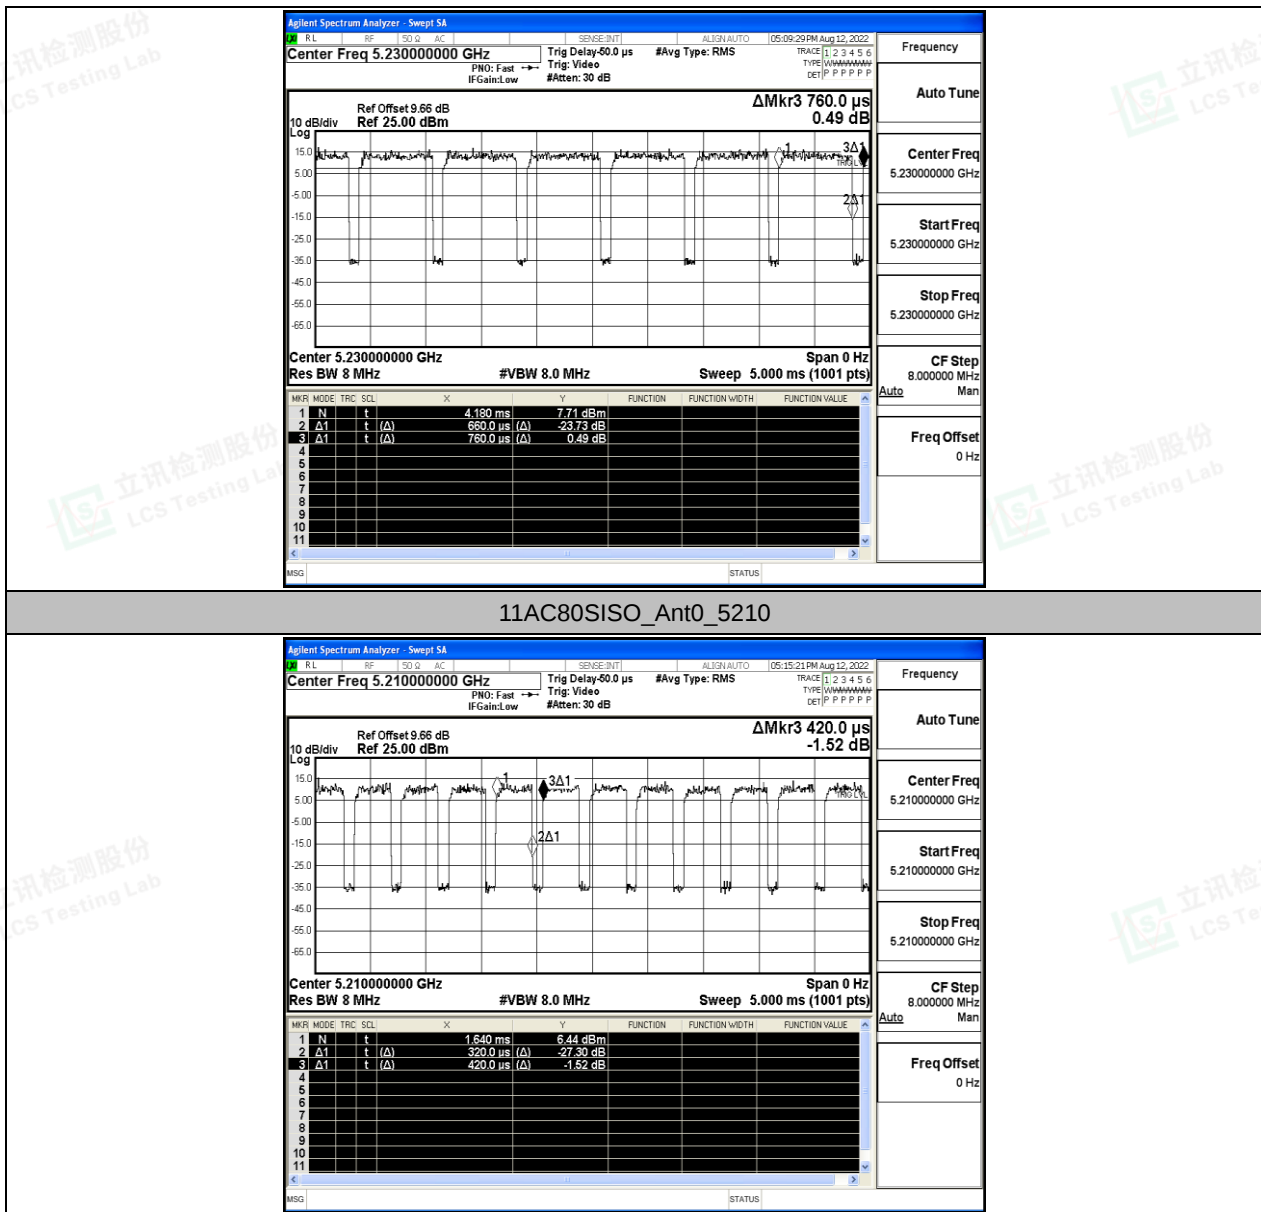

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




TestMode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Factor
11A	Ant1	5180	1.39	1.49	93.29	0.30
		5220	1.39	1.49	93.29	0.30
		5240	1.40	1.50	93.33	0.30
11N20SISO	Ant1	5180	1.30	1.40	92.86	0.32
		5220	1.30	1.40	92.86	0.32
		5240	1.30	1.40	92.86	0.32
11N40SISO	Ant1	5190	0.65	0.75	86.67	0.62
		5230	0.64	0.74	86.49	0.63
11AC20SISO	Ant1	5180	1.32	1.42	92.96	0.32
		5220	1.32	1.42	92.96	0.32
		5240	1.32	1.42	92.96	0.32
11AC40SISO	Ant1	5190	0.66	0.76	86.84	0.61
		5230	0.66	0.76	86.84	0.61
11AC80SISO	Ant1	5210	0.33	0.43	76.74	1.15






Test Graphs

11A_Ant1_5180

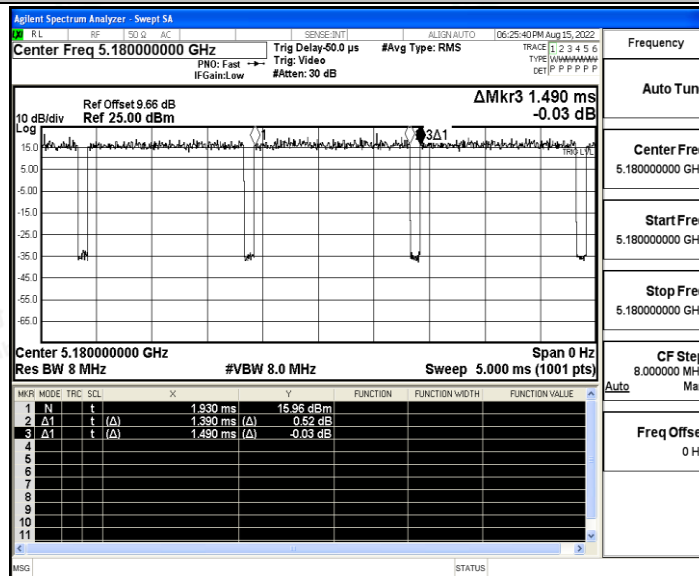

11A_Ant1_5220

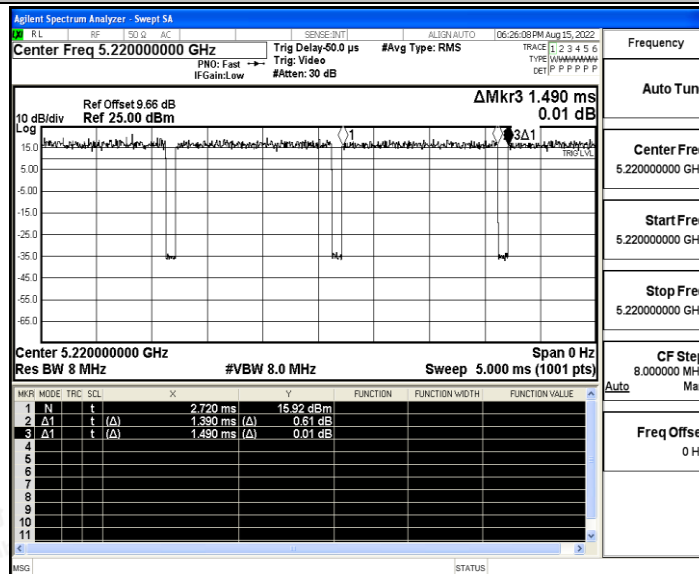

11A_Ant1_5240

