




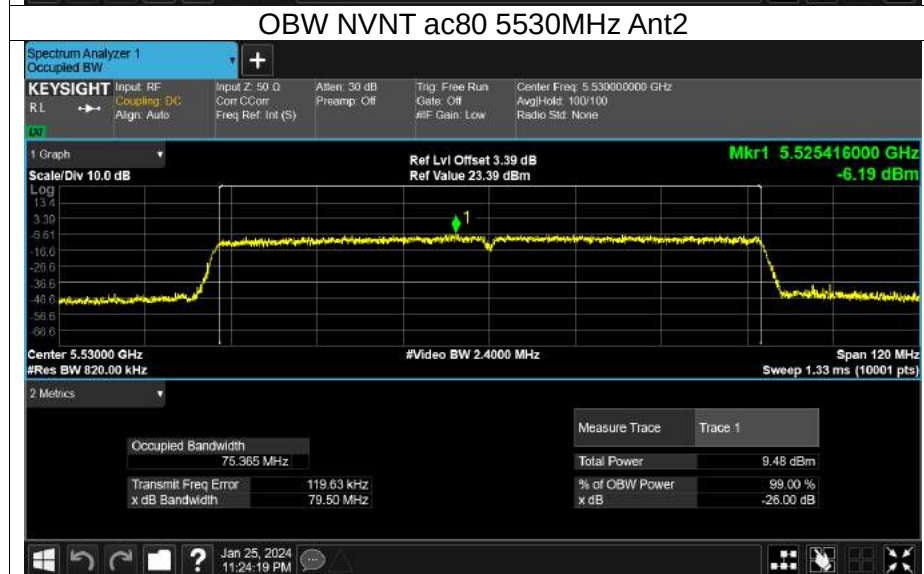
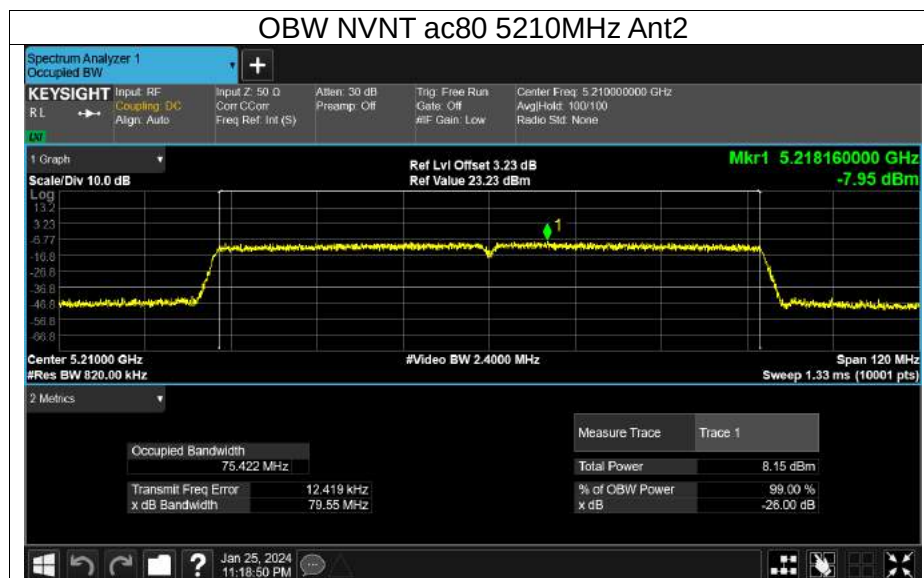
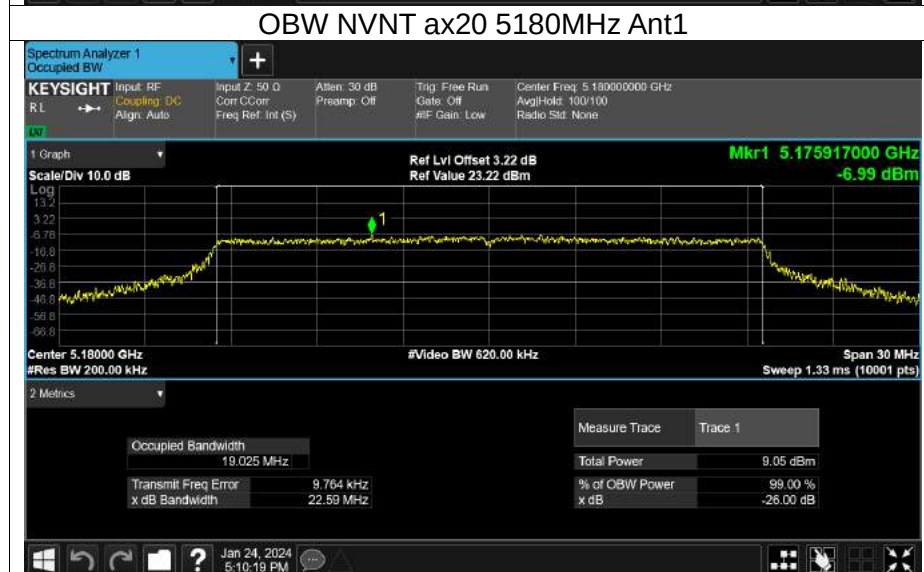


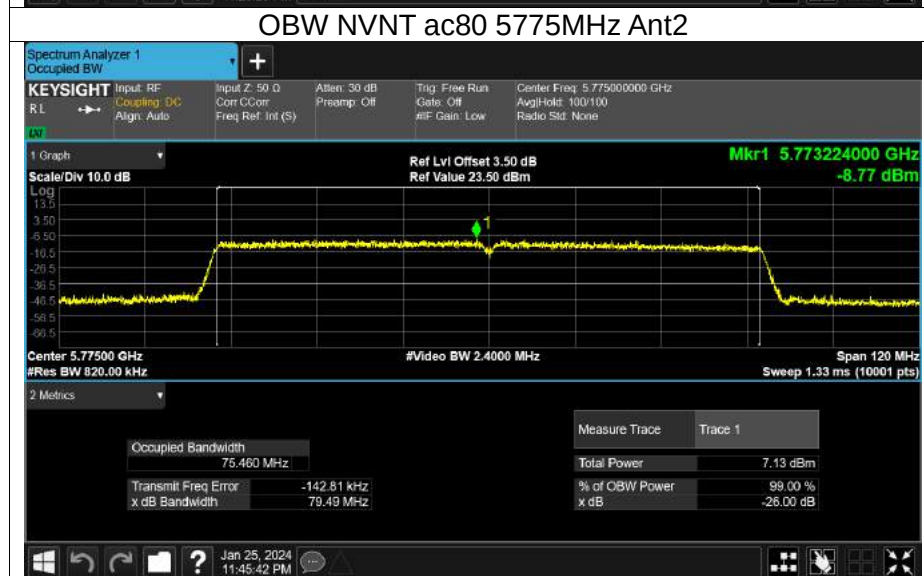

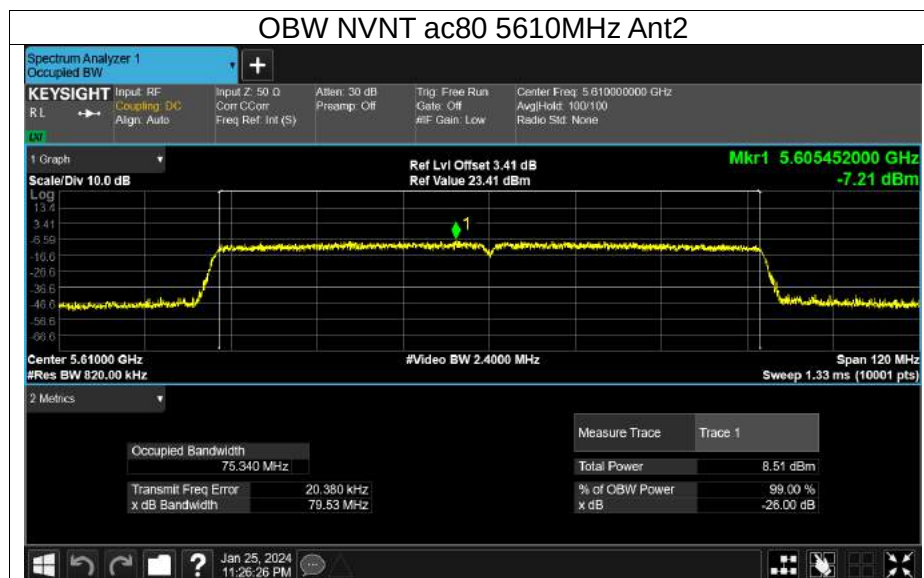


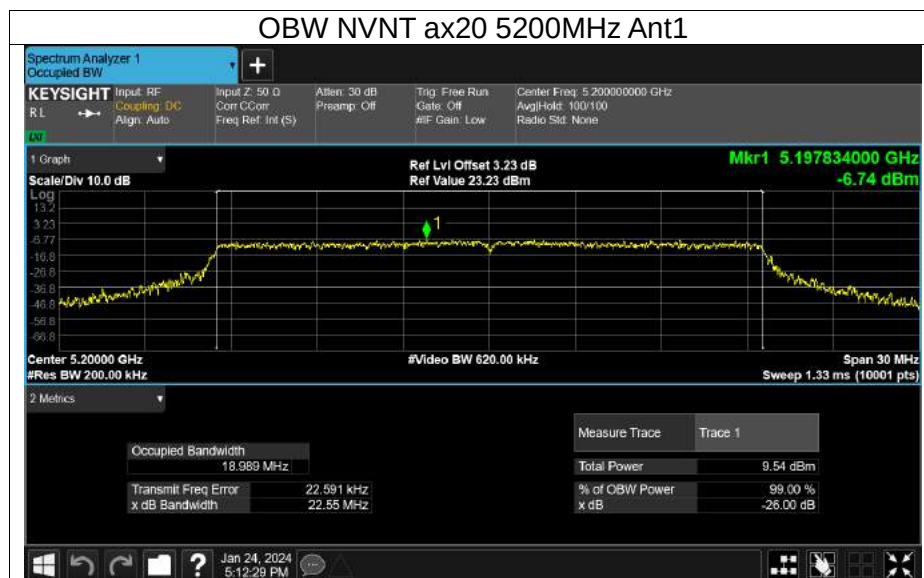


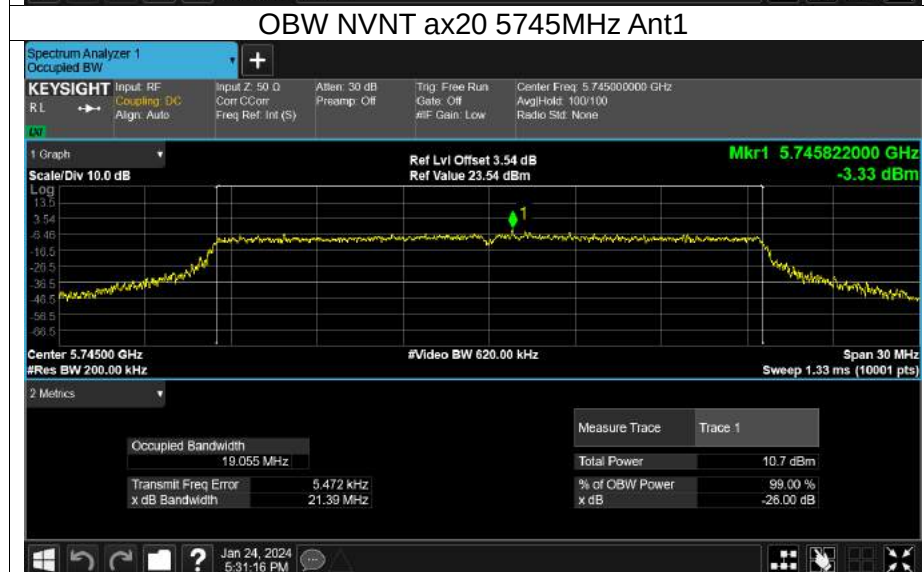



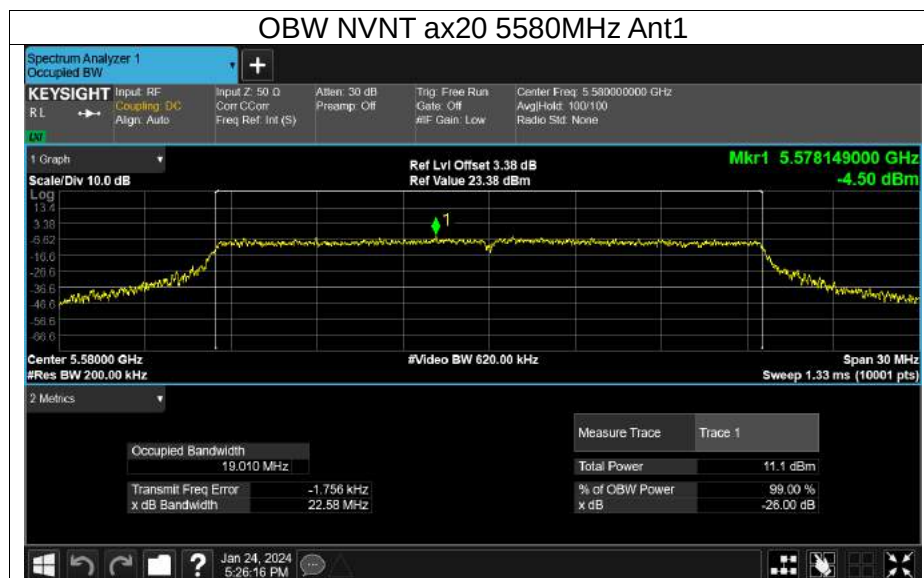





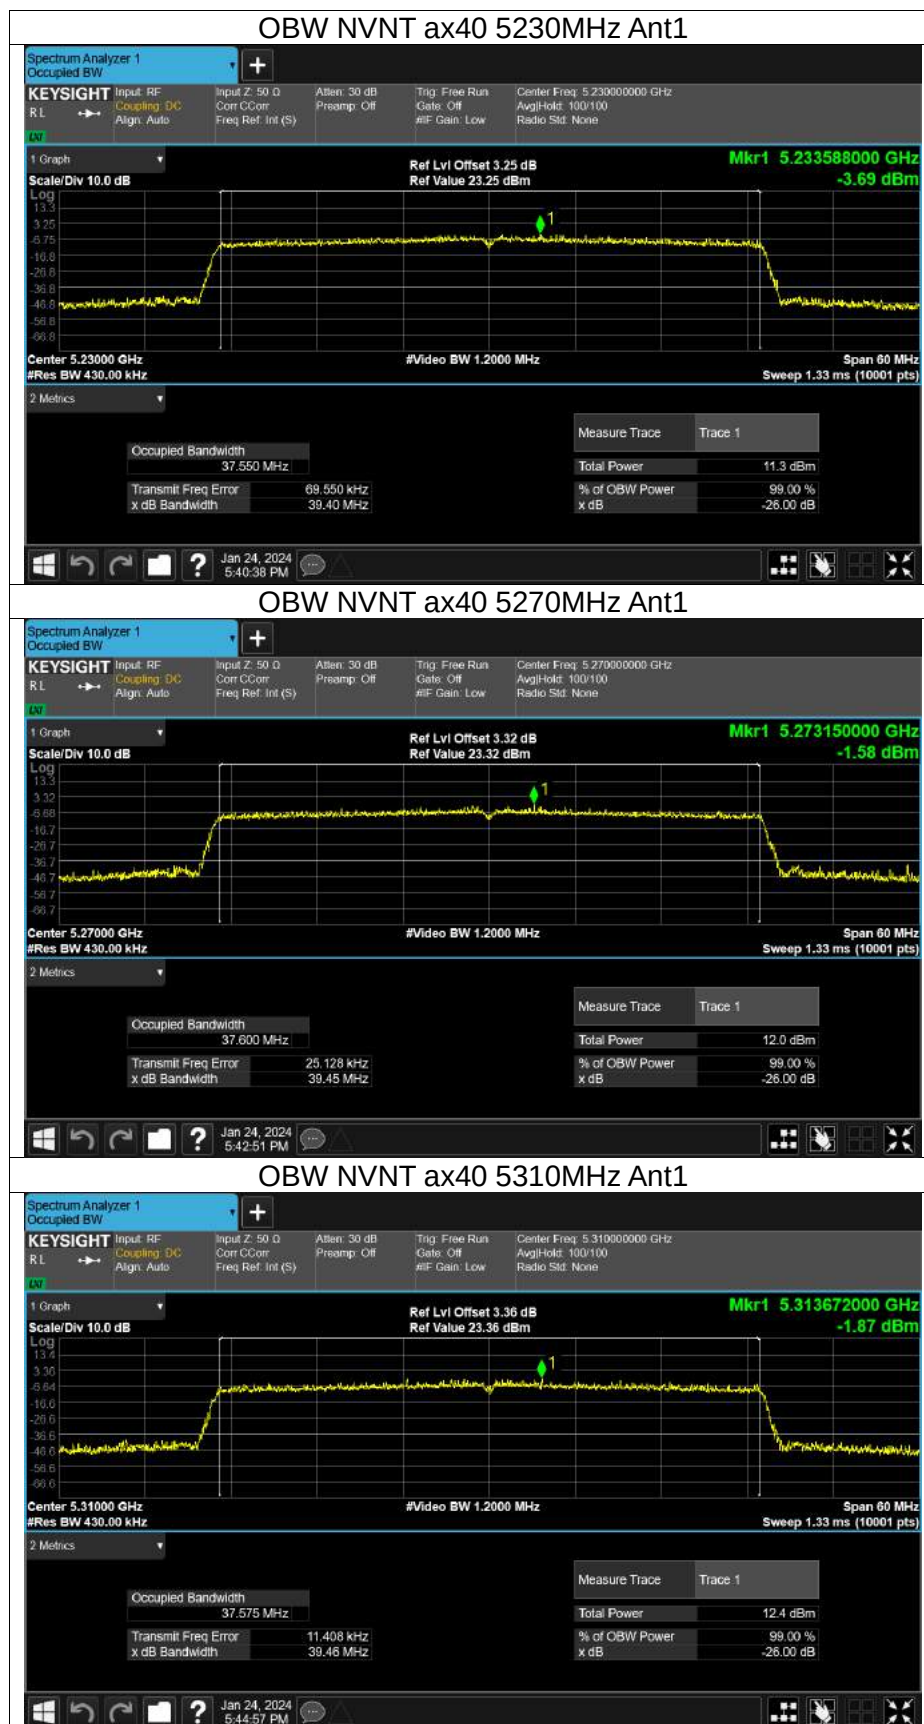

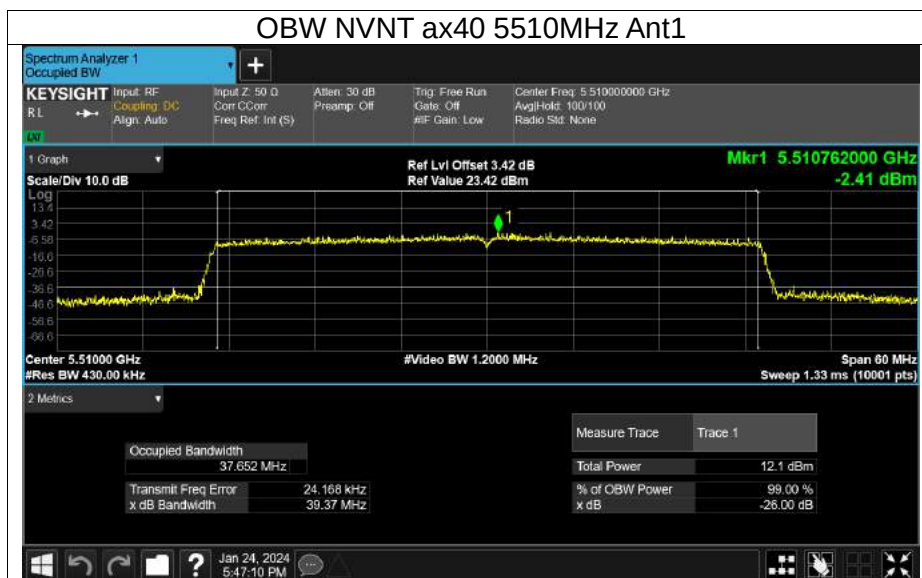

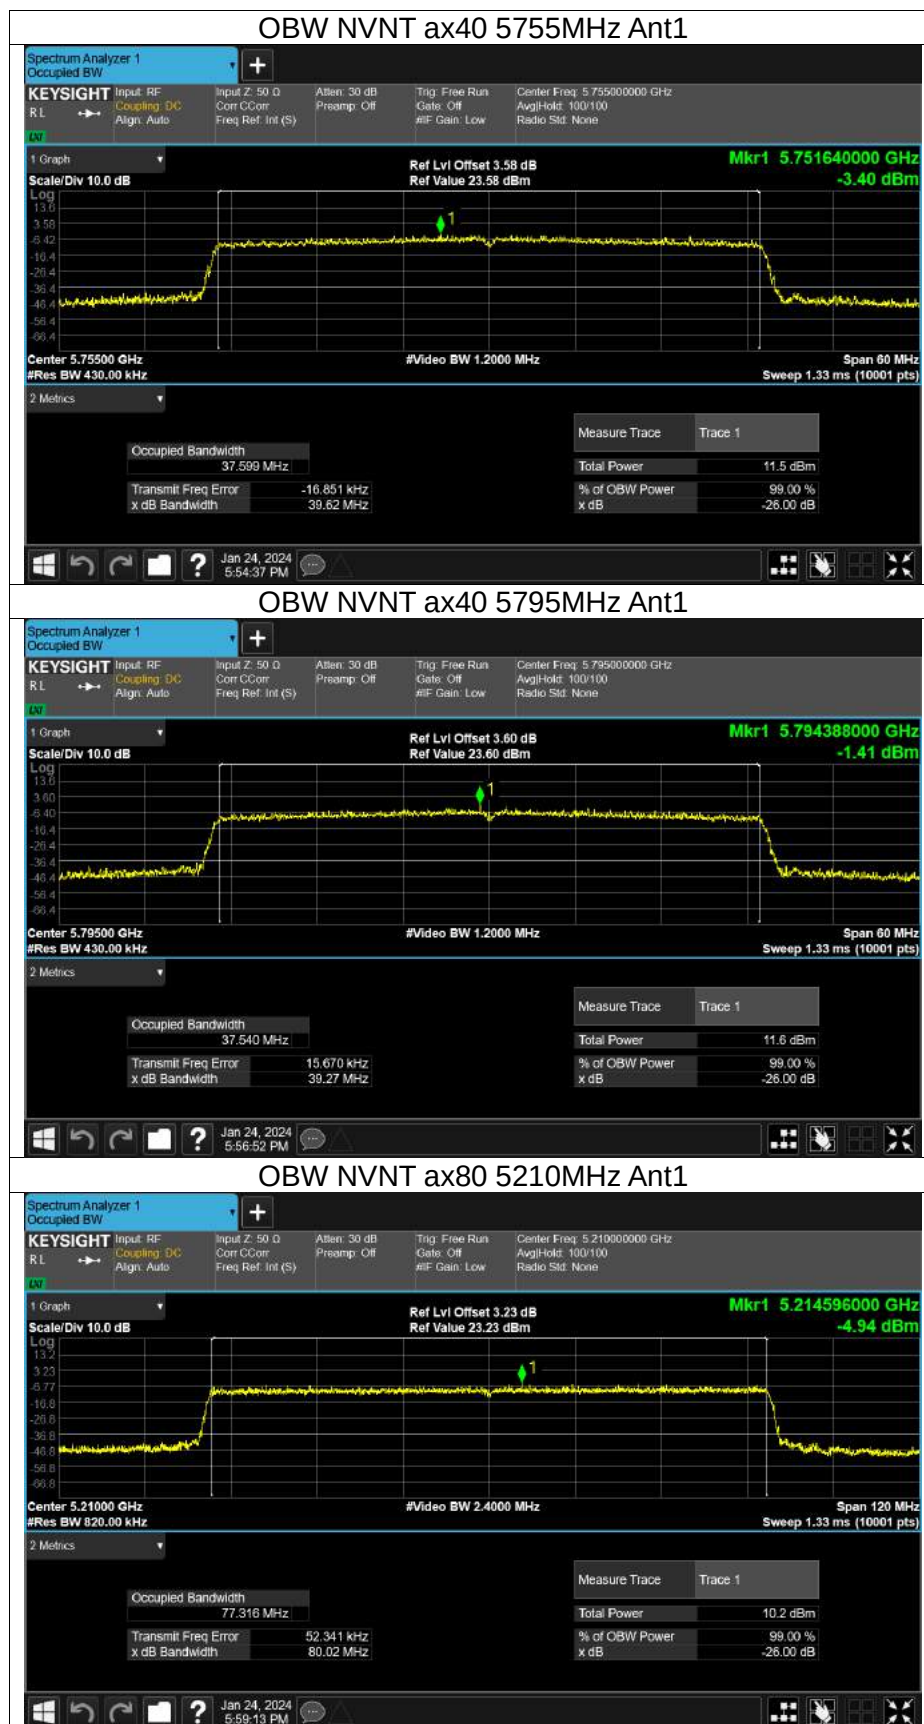

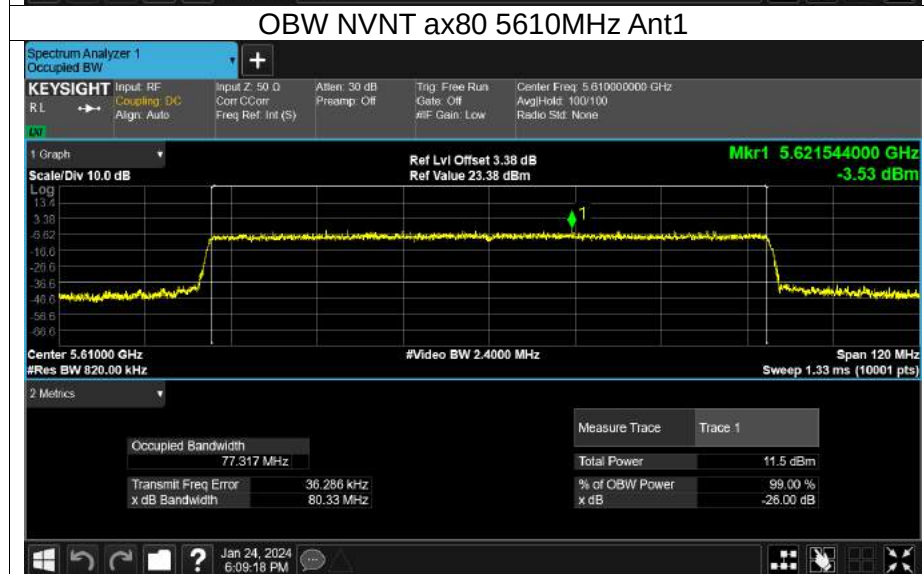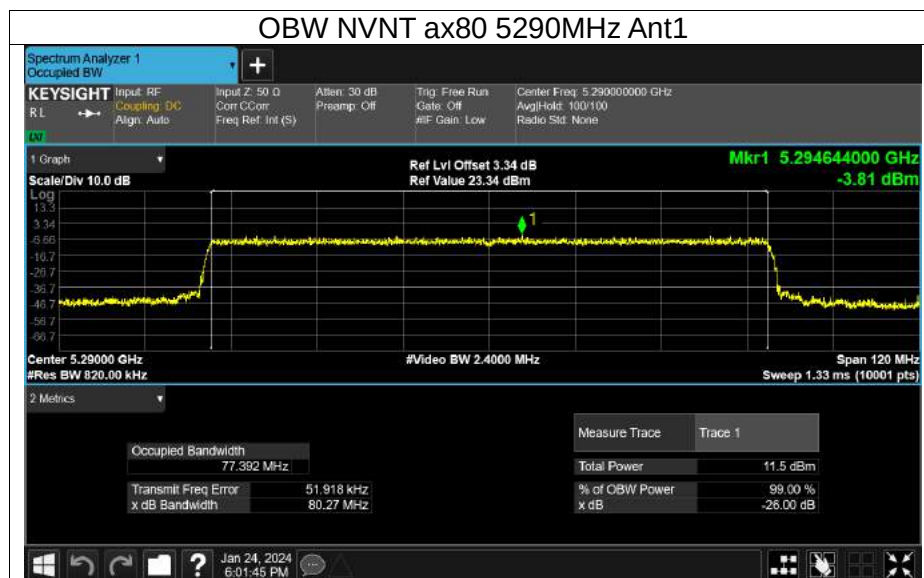

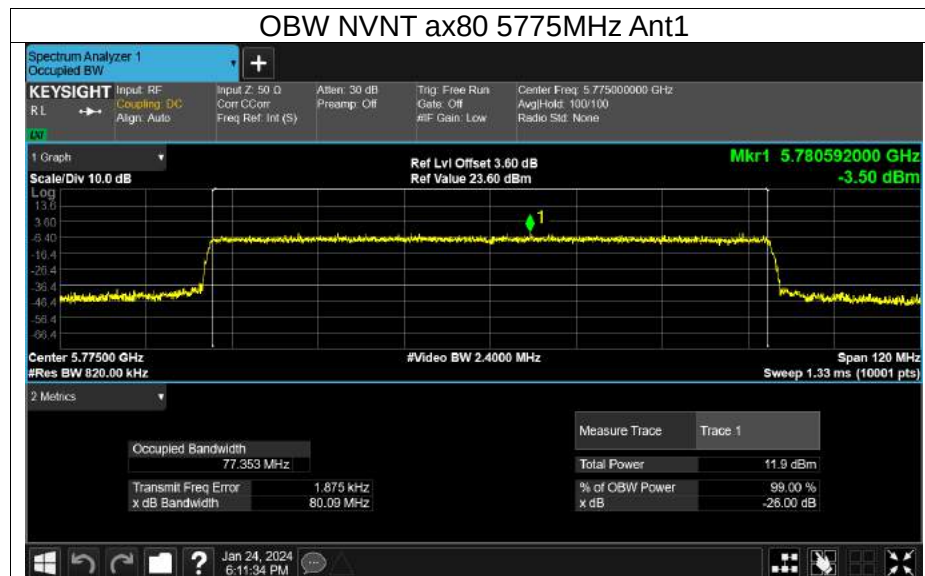



Maximum Power Spectral Density Level

Condi tion	Mod e	Frequen cy (MHz)	Anten na	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/M Hz)	Verdi ct
NVNT	a	5180	Ant1	-6.1	0	-6.1	11	Pass
NVNT	a	5200	Ant1	-5.86	0	-5.86	11	Pass
NVNT	a	5240	Ant1	-5.6	0	-5.6	11	Pass
NVNT	a	5260	Ant1	-5.33	0	-5.33	11	Pass
NVNT	a	5300	Ant1	-3.95	0	-3.95	11	Pass
NVNT	a	5320	Ant1	-4	0	-4	11	Pass
NVNT	a	5500	Ant1	-3.46	0	-3.46	11	Pass
NVNT	a	5580	Ant1	-3.64	0	-3.64	11	Pass
NVNT	a	5700	Ant1	-3.97	0	-3.97	11	Pass
NVNT	a	5180	Ant2	-6.83	0	-6.83	11	Pass
NVNT	a	5200	Ant2	-6.49	0	-6.49	11	Pass
NVNT	a	5240	Ant2	-5.39	0	-5.39	11	Pass
NVNT	a	5260	Ant2	-4.77	0	-4.77	11	Pass
NVNT	a	5300	Ant2	-5.11	0	-5.11	11	Pass
NVNT	a	5320	Ant2	-4.26	0	-4.26	11	Pass
NVNT	a	5500	Ant2	-4.17	0	-4.17	11	Pass
NVNT	a	5580	Ant2	-5.17	0	-5.17	11	Pass
NVNT	a	5700	Ant2	-6.52	0	-6.52	11	Pass
NVNT	n20	5180	Ant1	-7.45	0	-7.45	11	Pass
NVNT	n20	5200	Ant1	-7.36	0	-7.36	11	Pass
NVNT	n20	5240	Ant1	-6.87	0	-6.87	11	Pass
NVNT	n20	5260	Ant1	-6.13	0	-6.13	11	Pass
NVNT	n20	5300	Ant1	-5.45	0	-5.45	11	Pass
NVNT	n20	5320	Ant1	-5.3	0	-5.3	11	Pass
NVNT	n20	5500	Ant1	-4.69	0	-4.69	11	Pass
NVNT	n20	5580	Ant1	-4.62	0	-4.62	11	Pass
NVNT	n20	5700	Ant1	-5.2	0	-5.2	11	Pass
NVNT	n20	5180	Ant2	-8.85	0	-8.85	11	Pass
NVNT	n20	5200	Ant2	-8.47	0	-8.47	11	Pass
NVNT	n20	5240	Ant2	-8.35	0	-8.35	11	Pass
NVNT	n20	5260	Ant2	-7.12	0	-7.12	11	Pass
NVNT	n20	5300	Ant2	-7.26	0	-7.26	11	Pass
NVNT	n20	5320	Ant2	-7.33	0	-7.33	11	Pass
NVNT	n20	5500	Ant2	-6.37	0	-6.37	11	Pass
NVNT	n20	5580	Ant2	-7.82	0	-7.82	11	Pass
NVNT	n20	5700	Ant2	-8.97	0	-8.97	11	Pass
NVNT	n20	5180	Ant1	-8.48	0	-8.48	11	Pass
NVNT	n20	5180	Ant2	-9.11	0	-9.11	11	Pass
NVNT	n20	5180	Sum	-5.77	0	-5.77	11	Pass
NVNT	n20	5200	Ant1	-7.59	0	-7.59	11	Pass
NVNT	n20	5200	Ant2	-9.58	0	-9.58	11	Pass
NVNT	n20	5200	Sum	-5.46	0	-5.46	11	Pass
NVNT	n20	5240	Ant1	-7.61	0	-7.61	11	Pass
NVNT	n20	5240	Ant2	-8.89	0	-8.89	11	Pass
NVNT	n20	5240	Sum	-5.19	0	-5.19	11	Pass
NVNT	n20	5260	Ant1	-7.27	0	-7.27	11	Pass
NVNT	n20	5260	Ant2	-7.87	0	-7.87	11	Pass
NVNT	n20	5260	Sum	-4.55	0	-4.55	11	Pass
NVNT	n20	5300	Ant1	-5.77	0	-5.77	11	Pass
NVNT	n20	5300	Ant2	-8.38	0	-8.38	11	Pass
NVNT	n20	5300	Sum	-3.87	0	-3.87	11	Pass



NVNT	n20	5320	Ant1	-5.13	0	-5.13	11	Pass
NVNT	n20	5320	Ant2	-8.48	0	-8.48	11	Pass
NVNT	n20	5320	Sum	-3.48	0	-3.48	11	Pass
NVNT	n20	5500	Ant1	-5.77	0	-5.77	11	Pass
NVNT	n20	5500	Ant2	-7.57	0	-7.57	11	Pass
NVNT	n20	5500	Sum	-3.57	0	-3.57	11	Pass
NVNT	n20	5580	Ant1	-5.35	0	-5.35	11	Pass
NVNT	n20	5580	Ant2	-8.15	0	-8.15	11	Pass
NVNT	n20	5580	Sum	-3.52	0	-3.52	11	Pass
NVNT	n20	5700	Ant1	-5.42	0	-5.42	11	Pass
NVNT	n20	5700	Ant2	-9.88	0	-9.88	11	Pass
NVNT	n20	5700	Sum	-4.09	0	-4.09	11	Pass
NVNT	n40	5190	Ant1	-9.81	0	-9.81	11	Pass
NVNT	n40	5230	Ant1	-9.23	0	-9.23	11	Pass
NVNT	n40	5270	Ant1	-8.9	0	-8.9	11	Pass
NVNT	n40	5310	Ant1	-8.22	0	-8.22	11	Pass
NVNT	n40	5510	Ant1	-8.35	0	-8.35	11	Pass
NVNT	n40	5550	Ant1	-8.41	0	-8.41	11	Pass
NVNT	n40	5670	Ant1	-8.05	0	-8.05	11	Pass
NVNT	n40	5190	Ant2	-11.11	0	-11.11	11	Pass
NVNT	n40	5230	Ant2	-11.99	0	-11.99	11	Pass
NVNT	n40	5270	Ant2	-11.11	0	-11.11	11	Pass
NVNT	n40	5310	Ant2	-10.54	0	-10.54	11	Pass
NVNT	n40	5510	Ant2	-11.22	0	-11.22	11	Pass
NVNT	n40	5550	Ant2	-10.91	0	-10.91	11	Pass
NVNT	n40	5670	Ant2	-12.14	0	-12.14	11	Pass
NVNT	n40	5190	Ant1	-10.29	0	-10.29	11	Pass
NVNT	n40	5190	Ant2	-11.92	0	-11.92	11	Pass
NVNT	n40	5190	Sum	-8.02	0	-8.02	11	Pass
NVNT	n40	5230	Ant1	-10.25	0	-10.25	11	Pass
NVNT	n40	5230	Ant2	-11.44	0	-11.44	11	Pass
NVNT	n40	5230	Sum	-7.79	0	-7.79	11	Pass
NVNT	n40	5270	Ant1	-11.7	0	-11.7	11	Pass
NVNT	n40	5270	Ant2	-12.91	0	-12.91	11	Pass
NVNT	n40	5270	Sum	-9.25	0	-9.25	11	Pass
NVNT	n40	5310	Ant1	-8.04	0	-8.04	11	Pass
NVNT	n40	5310	Ant2	-10.76	0	-10.76	11	Pass
NVNT	n40	5310	Sum	-6.18	0	-6.18	11	Pass
NVNT	n40	5510	Ant1	-9.4	0	-9.4	11	Pass
NVNT	n40	5510	Ant2	-11.31	0	-11.31	11	Pass
NVNT	n40	5510	Sum	-7.24	0	-7.24	11	Pass
NVNT	n40	5550	Ant1	-8.56	0	-8.56	11	Pass
NVNT	n40	5550	Ant2	-11.29	0	-11.29	11	Pass
NVNT	n40	5550	Sum	-6.7	0	-6.7	11	Pass
NVNT	n40	5670	Ant1	-8.14	0	-8.14	11	Pass
NVNT	n40	5670	Ant2	-12.37	0	-12.37	11	Pass
NVNT	n40	5670	Sum	-6.75	0	-6.75	11	Pass
NVNT	ac20	5180	Ant1	-8.73	0	-8.73	11	Pass
NVNT	ac20	5200	Ant1	-8.13	0	-8.13	11	Pass
NVNT	ac20	5240	Ant1	-7.75	0	-7.75	11	Pass
NVNT	ac20	5260	Ant1	-6.67	0	-6.67	11	Pass
NVNT	ac20	5300	Ant1	-6.37	0	-6.37	11	Pass
NVNT	ac20	5320	Ant1	-6.48	0	-6.48	11	Pass
NVNT	ac20	5500	Ant1	-6	0	-6	11	Pass
NVNT	ac20	5580	Ant1	-6.06	0	-6.06	11	Pass
NVNT	ac20	5700	Ant1	-6.43	0	-6.43	11	Pass



NVNT	ac20	5180	Ant2	-11.14	0	-11.14	11	Pass
NVNT	ac20	5200	Ant2	-10.56	0	-10.56	11	Pass
NVNT	ac20	5240	Ant2	-9.8	0	-9.8	11	Pass
NVNT	ac20	5260	Ant2	-9.35	0	-9.35	11	Pass
NVNT	ac20	5300	Ant2	-9.25	0	-9.25	11	Pass
NVNT	ac20	5320	Ant2	-9.97	0	-9.97	11	Pass
NVNT	ac20	5500	Ant2	-9.01	0	-9.01	11	Pass
NVNT	ac20	5580	Ant2	-8.28	0	-8.28	11	Pass
NVNT	ac20	5700	Ant2	-11.72	0	-11.72	11	Pass
NVNT	ac20	5180	Ant1	-9.12	0	-9.12	11	Pass
NVNT	ac20	5180	Ant2	-10.63	0	-10.63	11	Pass
NVNT	ac20	5180	Sum	-6.8	0	-6.8	11	Pass
NVNT	ac20	5200	Ant1	-8.75	0	-8.75	11	Pass
NVNT	ac20	5200	Ant2	-10.62	0	-10.62	11	Pass
NVNT	ac20	5200	Sum	-6.57	0	-6.57	11	Pass
NVNT	ac20	5240	Ant1	-9.07	0	-9.07	11	Pass
NVNT	ac20	5240	Ant2	-10.77	0	-10.77	11	Pass
NVNT	ac20	5240	Sum	-6.83	0	-6.83	11	Pass
NVNT	ac20	5260	Ant1	-8.17	0	-8.17	11	Pass
NVNT	ac20	5260	Ant2	-9.65	0	-9.65	11	Pass
NVNT	ac20	5260	Sum	-5.84	0	-5.84	11	Pass
NVNT	ac20	5300	Ant1	-7.33	0	-7.33	11	Pass
NVNT	ac20	5300	Ant2	-10.13	0	-10.13	11	Pass
NVNT	ac20	5300	Sum	-5.5	0	-5.5	11	Pass
NVNT	ac20	5320	Ant1	-6.31	0	-6.31	11	Pass
NVNT	ac20	5320	Ant2	-9.96	0	-9.96	11	Pass
NVNT	ac20	5320	Sum	-4.75	0	-4.75	11	Pass
NVNT	ac20	5500	Ant1	-7.66	0	-7.66	11	Pass
NVNT	ac20	5500	Ant2	-9.62	0	-9.62	11	Pass
NVNT	ac20	5500	Sum	-5.52	0	-5.52	11	Pass
NVNT	ac20	5580	Ant1	-6.64	0	-6.64	11	Pass
NVNT	ac20	5580	Ant2	-10.11	0	-10.11	11	Pass
NVNT	ac20	5580	Sum	-5.03	0	-5.03	11	Pass
NVNT	ac20	5700	Ant1	-6.94	0	-6.94	11	Pass
NVNT	ac20	5700	Ant2	-11.35	0	-11.35	11	Pass
NVNT	ac20	5700	Sum	-5.6	0	-5.6	11	Pass
NVNT	ac40	5180	Ant1	-10.66	0	-10.66	11	Pass
NVNT	ac40	5190	Ant1	-10.96	0	-10.96	11	Pass
NVNT	ac40	5230	Ant1	-10.03	0	-10.03	11	Pass
NVNT	ac40	5270	Ant1	-9.55	0	-9.55	11	Pass
NVNT	ac40	5310	Ant1	-9.35	0	-9.35	11	Pass
NVNT	ac40	5510	Ant1	-9.21	0	-9.21	11	Pass
NVNT	ac40	5550	Ant1	-9.5	0	-9.5	11	Pass
NVNT	ac40	5670	Ant1	-9.42	0	-9.42	11	Pass
NVNT	ac40	5190	Ant2	-13.31	0	-13.31	11	Pass
NVNT	ac40	5230	Ant2	-12.46	0	-12.46	11	Pass
NVNT	ac40	5270	Ant2	-11.29	0	-11.29	11	Pass
NVNT	ac40	5310	Ant2	-11.46	0	-11.46	11	Pass
NVNT	ac40	5510	Ant2	-11.59	0	-11.59	11	Pass
NVNT	ac40	5550	Ant2	-11.81	0	-11.81	11	Pass
NVNT	ac40	5670	Ant2	-13.39	0	-13.39	11	Pass
NVNT	ac40	5190	Ant1	-10.73	0	-10.73	11	Pass
NVNT	ac40	5190	Ant2	-13.06	0	-13.06	11	Pass
NVNT	ac40	5190	Sum	-8.73	0	-8.73	11	Pass
NVNT	ac40	5230	Ant1	-11.09	0	-11.09	11	Pass
NVNT	ac40	5230	Ant2	-12.07	0	-12.07	11	Pass



NVNT	ac40	5230	Sum	-8.54	0	-8.54	11	Pass
NVNT	ac40	5270	Ant1	-10.3	0	-10.3	11	Pass
NVNT	ac40	5270	Ant2	-11.52	0	-11.52	11	Pass
NVNT	ac40	5270	Sum	-7.86	0	-7.86	11	Pass
NVNT	ac40	5310	Ant1	-8.56	0	-8.56	11	Pass
NVNT	ac40	5310	Ant2	-11.61	0	-11.61	11	Pass
NVNT	ac40	5310	Sum	-6.81	0	-6.81	11	Pass
NVNT	ac40	5510	Ant1	-10.04	0	-10.04	11	Pass
NVNT	ac40	5510	Ant2	-11.51	0	-11.51	11	Pass
NVNT	ac40	5510	Sum	-7.7	0	-7.7	11	Pass
NVNT	ac40	5550	Ant1	-8.68	0	-8.68	11	Pass
NVNT	ac40	5550	Ant2	-11.31	0	-11.31	11	Pass
NVNT	ac40	5550	Sum	-6.79	0	-6.79	11	Pass
NVNT	ac40	5670	Ant1	-8.71	0	-8.71	11	Pass
NVNT	ac40	5670	Ant2	-13.01	0	-13.01	11	Pass
NVNT	ac40	5670	Sum	-7.34	0	-7.34	11	Pass
NVNT	ac80	5210	Ant1	-14.78	0	-14.78	11	Pass
NVNT	ac80	5290	Ant1	-12.31	0	-12.31	11	Pass
NVNT	ac80	5530	Ant1	-13.34	0	-13.34	11	Pass
NVNT	ac80	5610	Ant1	-13.5	0	-13.5	11	Pass
NVNT	ac80	5210	Ant2	-17.37	0	-17.37	11	Pass
NVNT	ac80	5290	Ant2	-16.15	0	-16.15	11	Pass
NVNT	ac80	5530	Ant2	-15.87	0	-15.87	11	Pass
NVNT	ac80	5610	Ant2	-16.86	0	-16.86	11	Pass
NVNT	ac80	5210	Ant1	-14.93	0	-14.93	11	Pass
NVNT	ac80	5210	Ant2	-17.44	0	-17.44	11	Pass
NVNT	ac80	5210	Sum	-13	0	-13	11	Pass
NVNT	ac80	5290	Ant1	-13.55	0	-13.55	11	Pass
NVNT	ac80	5290	Ant2	-15.93	0	-15.93	11	Pass
NVNT	ac80	5290	Sum	-11.57	0	-11.57	11	Pass
NVNT	ac80	5530	Ant1	-13.23	0	-13.23	11	Pass
NVNT	ac80	5530	Ant2	-15.81	0	-15.81	11	Pass
NVNT	ac80	5530	Sum	-11.32	0	-11.32	11	Pass
NVNT	ac80	5610	Ant1	-13.82	0	-13.82	11	Pass
NVNT	ac80	5610	Ant2	-16.69	0	-16.69	11	Pass
NVNT	ac80	5610	Sum	-12.01	0	-12.01	11	Pass
NVNT	ax20	5180	Ant1	-9.65	0	-9.65	11	Pass
NVNT	ax20	5200	Ant1	-9.63	0	-9.63	11	Pass
NVNT	ax20	5240	Ant1	-8.94	0	-8.94	11	Pass
NVNT	ax20	5260	Ant1	-8.49	0	-8.49	11	Pass
NVNT	ax20	5300	Ant1	-7.27	0	-7.27	11	Pass
NVNT	ax20	5320	Ant1	-6.78	0	-6.78	11	Pass
NVNT	ax20	5500	Ant1	-7.74	0	-7.74	11	Pass
NVNT	ax20	5580	Ant1	-7.77	0	-7.77	11	Pass
NVNT	ax20	5700	Ant1	-7.8	0	-7.8	11	Pass
NVNT	ax20	5180	Ant2	-11.73	0	-11.73	11	Pass
NVNT	ax20	5200	Ant2	-12.21	0	-12.21	11	Pass
NVNT	ax20	5240	Ant2	-11.57	0	-11.57	11	Pass
NVNT	ax20	5260	Ant2	-11.13	0	-11.13	11	Pass
NVNT	ax20	5300	Ant2	-11.33	0	-11.33	11	Pass
NVNT	ax20	5320	Ant2	-10.53	0	-10.53	11	Pass
NVNT	ax20	5500	Ant2	-10.43	0	-10.43	11	Pass
NVNT	ax20	5580	Ant2	-10.98	0	-10.98	11	Pass
NVNT	ax20	5700	Ant2	-11.91	0	-11.91	11	Pass
NVNT	ax20	5180	Ant1	-8.65	0	-8.65	11	Pass
NVNT	ax20	5180	Ant2	-10.98	0	-10.98	11	Pass



NVNT	ax20	5180	Sum	-6.65	0	-6.65	11	Pass
NVNT	ax20	5200	Ant1	-8.64	0	-8.64	11	Pass
NVNT	ax20	5200	Ant2	-10.82	0	-10.82	11	Pass
NVNT	ax20	5200	Sum	-6.58	0	-6.58	11	Pass
NVNT	ax20	5240	Ant1	-8.97	0	-8.97	11	Pass
NVNT	ax20	5240	Ant2	-10.35	0	-10.35	11	Pass
NVNT	ax20	5240	Sum	-6.6	0	-6.6	11	Pass
NVNT	ax20	5260	Ant1	-8.78	0	-8.78	11	Pass
NVNT	ax20	5260	Ant2	-9.93	0	-9.93	11	Pass
NVNT	ax20	5260	Sum	-6.31	0	-6.31	11	Pass
NVNT	ax20	5300	Ant1	-7.11	0	-7.11	11	Pass
NVNT	ax20	5300	Ant2	-9.7	0	-9.7	11	Pass
NVNT	ax20	5300	Sum	-5.2	0	-5.2	11	Pass
NVNT	ax20	5320	Ant1	-6.27	0	-6.27	11	Pass
NVNT	ax20	5320	Ant2	-9.7	0	-9.7	11	Pass
NVNT	ax20	5320	Sum	-4.64	0	-4.64	11	Pass
NVNT	ax20	5500	Ant1	-7.5	0	-7.5	11	Pass
NVNT	ax20	5500	Ant2	-9.7	0	-9.7	11	Pass
NVNT	ax20	5500	Sum	-5.45	0	-5.45	11	Pass
NVNT	ax20	5580	Ant1	-6.8	0	-6.8	11	Pass
NVNT	ax20	5580	Ant2	-10.11	0	-10.11	11	Pass
NVNT	ax20	5580	Sum	-5.14	0	-5.14	11	Pass
NVNT	ax20	5700	Ant1	-7.05	0	-7.05	11	Pass
NVNT	ax20	5700	Ant2	-10.57	0	-10.57	11	Pass
NVNT	ax20	5700	Sum	-5.45	0	-5.45	11	Pass
NVNT	ax40	5190	Ant1	-10.42	0	-10.42	11	Pass
NVNT	ax40	5230	Ant1	-10.13	0	-10.13	11	Pass
NVNT	ax40	5270	Ant1	-9.25	0	-9.25	11	Pass
NVNT	ax40	5310	Ant1	-9.32	0	-9.32	11	Pass
NVNT	ax40	5510	Ant1	-9.56	0	-9.56	11	Pass
NVNT	ax40	5550	Ant1	-8.79	0	-8.79	11	Pass
NVNT	ax40	5670	Ant1	-9.99	0	-9.99	11	Pass
NVNT	ax40	5190	Ant2	-13.88	0	-13.88	11	Pass
NVNT	ax40	5230	Ant2	-13.55	0	-13.55	11	Pass
NVNT	ax40	5270	Ant2	-12.28	0	-12.28	11	Pass
NVNT	ax40	5310	Ant2	-12.67	0	-12.67	11	Pass
NVNT	ax40	5510	Ant2	-13.2	0	-13.2	11	Pass
NVNT	ax40	5550	Ant2	-12.85	0	-12.85	11	Pass
NVNT	ax40	5670	Ant2	-14.43	0	-14.43	11	Pass
NVNT	ax40	5190	Ant1	-11.34	0	-11.34	11	Pass
NVNT	ax40	5190	Ant2	-13.47	0	-13.47	11	Pass
NVNT	ax40	5190	Sum	-9.27	0	-9.27	11	Pass
NVNT	ax40	5230	Ant1	-11.89	0	-11.89	11	Pass
NVNT	ax40	5230	Ant2	-13.38	0	-13.38	11	Pass
NVNT	ax40	5230	Sum	-9.56	0	-9.56	11	Pass
NVNT	ax40	5270	Ant1	-11.28	0	-11.28	11	Pass
NVNT	ax40	5270	Ant2	-12.31	0	-12.31	11	Pass
NVNT	ax40	5270	Sum	-8.75	0	-8.75	11	Pass
NVNT	ax40	5310	Ant1	-9.68	0	-9.68	11	Pass
NVNT	ax40	5310	Ant2	-12.82	0	-12.82	11	Pass
NVNT	ax40	5310	Sum	-7.96	0	-7.96	11	Pass
NVNT	ax40	5510	Ant1	-11.71	0	-11.71	11	Pass
NVNT	ax40	5510	Ant2	-13.46	0	-13.46	11	Pass
NVNT	ax40	5510	Sum	-9.49	0	-9.49	11	Pass
NVNT	ax40	5550	Ant1	-9.72	0	-9.72	11	Pass
NVNT	ax40	5550	Ant2	-12.95	0	-12.95	11	Pass



NVNT	ax40	5550	Sum	-8.03	0	-8.03	11	Pass
NVNT	ax40	5670	Ant1	-9.84	0	-9.84	11	Pass
NVNT	ax40	5670	Ant2	-14.27	0	-14.27	11	Pass
NVNT	ax40	5670	Sum	-8.5	0	-8.5	11	Pass
NVNT	ax80	5210	Ant1	-16.04	0	-16.04	11	Pass
NVNT	ax80	5290	Ant1	-14.65	0	14.65	11	Pass
NVNT	ax80	5530	Ant1	-14.42	0	-14.42	11	Pass
NVNT	ax80	5610	Ant1	-14.57	0	-14.57	11	Pass
NVNT	ax80	5210	Ant2	-18.16	0	-18.16	11	Pass
NVNT	ax80	5290	Ant2	-16.88	0	-16.88	11	Pass
NVNT	ax80	5530	Ant2	-16.84	0	-16.84	11	Pass
NVNT	ax80	5610	Ant2	-18.18	0	-18.18	11	Pass
NVNT	ax80	5210	Ant1	-16.31	0	-16.31	11	Pass
NVNT	ax80	5210	Ant2	-18.37	0	-18.37	11	Pass
NVNT	ax80	5210	Sum	-14.21	0	-14.21	11	Pass
NVNT	ax80	5290	Ant1	-14.63	0	-14.63	11	Pass
NVNT	ax80	5290	Ant2	-17	0	-17	11	Pass
NVNT	ax80	5290	Sum	-12.64	0	-12.64	11	Pass
NVNT	ax80	5530	Ant1	-14.25	0	-14.25	11	Pass
NVNT	ax80	5530	Ant2	-16.61	0	-16.61	11	Pass
NVNT	ax80	5530	Sum	-12.26	0	-12.26	11	Pass
NVNT	ax80	5610	Ant1	-15.24	0	-15.24	11	Pass
NVNT	ax80	5610	Ant2	-17.7	0	-17.7	11	Pass
NVNT	ax80	5610	Sum	-13.29	0	-13.29	11	Pass
Condi tion	Mod e	Frequen cy (MHz)	Anten na	Conducted PSD (dBm/500k Hz)	Duty Factor (dB)	Total PSD (dBm/500k Hz)	Limit (dBm/50 0kHz)	Verdi ct
NVNT	a	5745	Ant1	-7.22	0	-7.22	30	Pass
NVNT	a	5785	Ant1	-7.46	0	-7.46	30	Pass
NVNT	a	5825	Ant1	-8.04	0	-8.04	30	Pass
NVNT	a	5745	Ant2	-9.67	0	-9.67	30	Pass
NVNT	a	5785	Ant2	-9.75	0	-9.75	30	Pass
NVNT	a	5825	Ant2	-10.84	0	-10.84	30	Pass
NVNT	n20	5745	Ant1	-8.6	0	-8.6	30	Pass
NVNT	n20	5785	Ant1	-9.14	0	-9.14	30	Pass
NVNT	n20	5825	Ant1	-9.17	0	-9.17	30	Pass
NVNT	n20	5745	Ant2	-11.82	0	-11.82	30	Pass
NVNT	n20	5785	Ant2	-12.2	0	-12.2	30	Pass
NVNT	n20	5825	Ant2	-12.93	0	-12.93	30	Pass
NVNT	n20	5745	Ant1	-9.41	0	-9.41	30	Pass
NVNT	n20	5745	Ant2	-12.35	0	-12.35	30	Pass
NVNT	n20	5745	Sum	-7.63	0	-7.63	30	Pass
NVNT	n20	5785	Ant1	-8.42	0	-8.42	30	Pass
NVNT	n20	5785	Ant2	-12.98	0	-12.98	30	Pass
NVNT	n20	5785	Sum	-7.12	0	-7.12	30	Pass
NVNT	n20	5825	Ant1	-8.4	0	-8.4	30	Pass
NVNT	n20	5825	Ant2	-13.11	0	-13.11	30	Pass
NVNT	n20	5825	Sum	-7.14	0	-7.14	30	Pass
NVNT	n40	5755	Ant1	-11.21	0	-11.21	30	Pass
NVNT	n40	5795	Ant1	-11.15	0	-11.15	30	Pass
NVNT	n40	5755	Ant2	-15.5	0	-15.5	30	Pass
NVNT	n40	5795	Ant2	-15.71	0	-15.71	30	Pass
NVNT	n40	5755	Ant1	-11.22	0	-11.22	30	Pass
NVNT	n40	5755	Ant2	-15.25	0	-15.25	30	Pass
NVNT	n40	5755	Sum	-9.77	0	-9.77	30	Pass



NVNT	n40	5795	Ant1	-10.67	0	-10.67	30	Pass
NVNT	n40	5795	Ant2	-15.63	0	-15.63	30	Pass
NVNT	n40	5795	Sum	-9.47	0	-9.47	30	Pass
NVNT	ac20	5745	Ant1	-9.68	0	-9.68	30	Pass
NVNT	ac20	5785	Ant1	-9.64	0	-9.64	30	Pass
NVNT	ac20	5825	Ant1	-9.94	0	-9.94	30	Pass
NVNT	ac20	5745	Ant2	-12.95	0	-12.95	30	Pass
NVNT	ac20	5785	Ant2	-14.09	0	-14.09	30	Pass
NVNT	ac20	5825	Ant2	-14.4	0	-14.4	30	Pass
NVNT	ac20	5745	Ant1	-10.86	0	-10.86	30	Pass
NVNT	ac20	5745	Ant2	-14.21	0	-14.21	30	Pass
NVNT	ac20	5745	Sum	-9.21	0	-9.21	30	Pass
NVNT	ac20	5785	Ant1	-10.13	0	-10.13	30	Pass
NVNT	ac20	5785	Ant2	-14.95	0	-14.95	30	Pass
NVNT	ac20	5785	Sum	-8.89	0	-8.89	30	Pass
NVNT	ac20	5825	Ant1	-10.61	0	-10.61	30	Pass
NVNT	ac20	5825	Ant2	-14.6	0	-14.6	30	Pass
NVNT	ac20	5825	Sum	-9.15	0	-9.15	30	Pass
NVNT	ac40	5755	Ant1	-12.26	0	-12.26	30	Pass
NVNT	ac40	5795	Ant1	-11.76	0	-11.76	30	Pass
NVNT	ac40	5755	Ant2	-16.61	0	-16.61	30	Pass
NVNT	ac40	5795	Ant2	-16.94	0	-16.94	30	Pass
NVNT	ac40	5755	Ant1	-12.07	0	-12.07	30	Pass
NVNT	ac40	5755	Ant2	-15.33	0	-15.33	30	Pass
NVNT	ac40	5755	Sum	-10.39	0	-10.39	30	Pass
NVNT	ac40	5795	Ant1	-12.18	0	-12.18	30	Pass
NVNT	ac40	5795	Ant2	-16.74	0	-16.74	30	Pass
NVNT	ac40	5795	Sum	-10.88	0	-10.88	30	Pass
NVNT	ac80	5775	Ant1	-16.49	0	-16.49	30	Pass
NVNT	ac80	5775	Ant2	-20.97	0	-20.97	30	Pass
NVNT	ac80	5775	Ant1	-16.58	0	-16.58	30	Pass
NVNT	ac80	5775	Ant2	-19.73	0	-19.73	30	Pass
NVNT	ac80	5775	Sum	-14.87	0	-14.87	30	Pass
NVNT	ax20	5745	Ant1	-10.94	0	-10.94	30	Pass
NVNT	ax20	5785	Ant1	-11.02	0	-11.02	30	Pass
NVNT	ax20	5825	Ant1	-11.32	0	-11.32	30	Pass
NVNT	ax20	5745	Ant2	-15.17	0	-15.17	30	Pass
NVNT	ax20	5785	Ant2	-15.41	0	-15.41	30	Pass
NVNT	ax20	5825	Ant2	-15.63	0	-15.63	30	Pass
NVNT	ax20	5745	Ant1	-11.11	0	-11.11	30	Pass
NVNT	ax20	5745	Ant2	-13.92	0	-13.92	30	Pass
NVNT	ax20	5745	Sum	-9.28	0	-9.28	30	Pass
NVNT	ax20	5785	Ant1	-10.38	0	-10.38	30	Pass
NVNT	ax20	5785	Ant2	-14.76	0	-14.76	30	Pass
NVNT	ax20	5785	Sum	-9.03	0	-9.03	30	Pass
NVNT	ax20	5825	Ant1	-10.76	0	-10.76	30	Pass
NVNT	ax20	5825	Ant2	-15.76	0	-15.76	30	Pass
NVNT	ax20	5825	Sum	-9.57	0	-9.57	30	Pass
NVNT	ax40	5755	Ant1	-12.51	0	-12.51	30	Pass
NVNT	ax40	5795	Ant1	-12.93	0	-12.93	30	Pass
NVNT	ax40	5755	Ant2	-17.1	0	-17.1	30	Pass
NVNT	ax40	5795	Ant2	-17.59	0	-17.59	30	Pass
NVNT	ax40	5755	Ant1	-13.67	0	-13.67	30	Pass
NVNT	ax40	5755	Ant2	-17.68	0	-17.68	30	Pass
NVNT	ax40	5755	Sum	-12.22	0	-12.22	30	Pass
NVNT	ax40	5795	Ant1	-12.39	0	-12.39	30	Pass



NVNT	ax40	5795	Ant2	-17.5	0	-17.5	30	Pass
NVNT	ax40	5795	Sum	-11.22	0	-11.22	30	Pass
NVNT	ax80	5775	Ant1	-17.11	0	-17.11	30	Pass
NVNT	ax80	5775	Ant2	-21.55	0	-21.55	30	Pass
NVNT	ax80	5775	Ant1	-17.46	0	-17.46	30	Pass
NVNT	ax80	5775	Ant2	-21.48	0	-21.48	30	Pass
NVNT	ax80	5775	Sum	-16.01	0	-16.01	30	Pass

