





Band41-5MHz-16QAM-41215-1RB#0

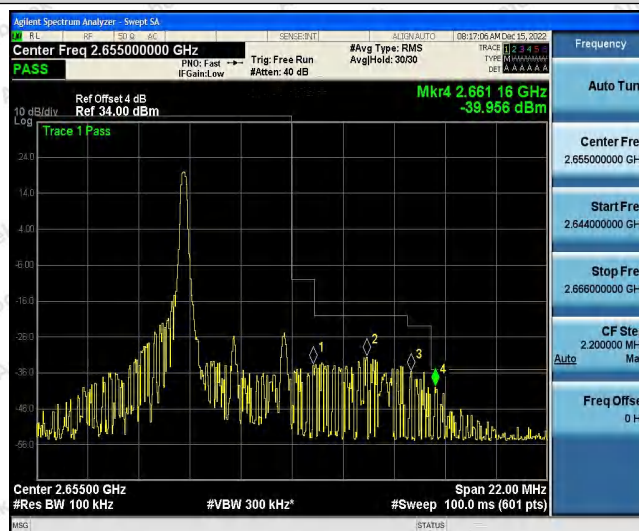

Band41-5MHz-16QAM-41215-1RB#24

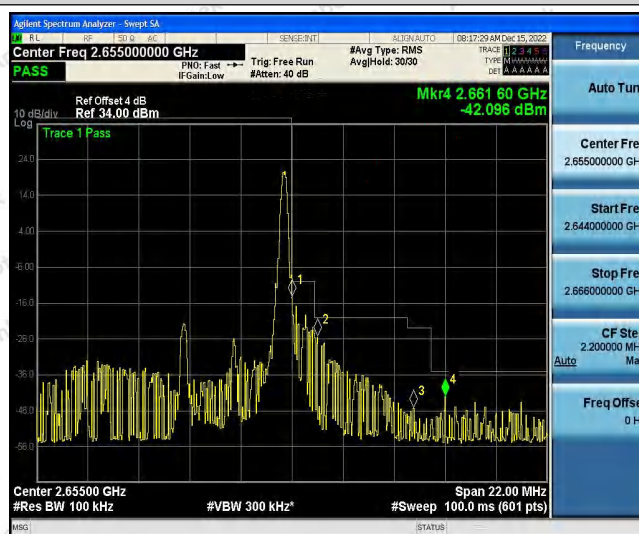

Band41-5MHz-16QAM-41215-25RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




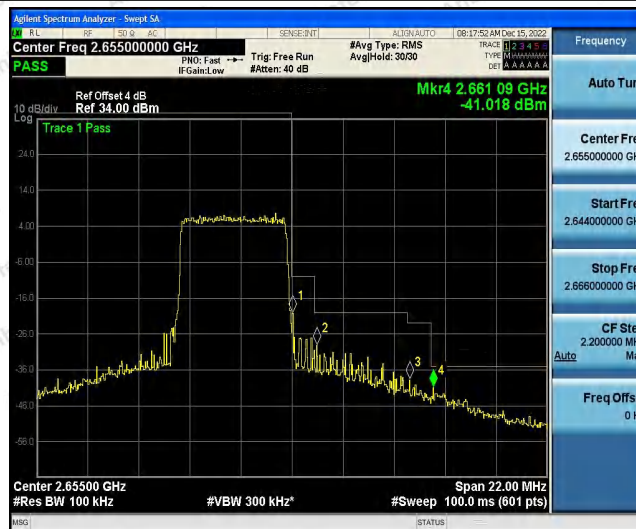

Band41-10MHz-QPSK-40090-1RB#0

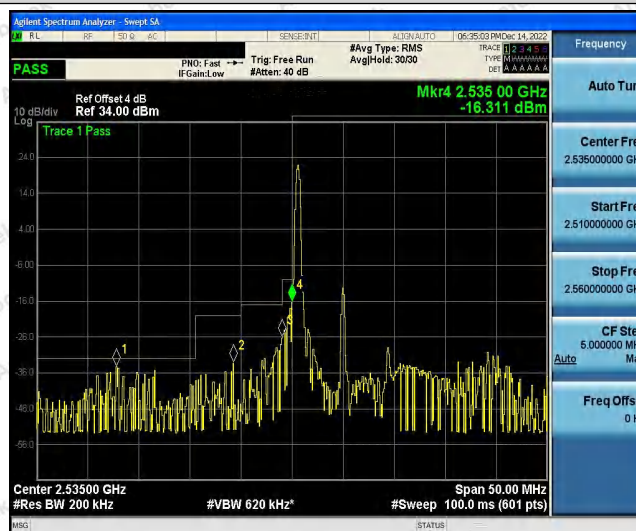

Band41-10MHz-QPSK-40090-1RB#49

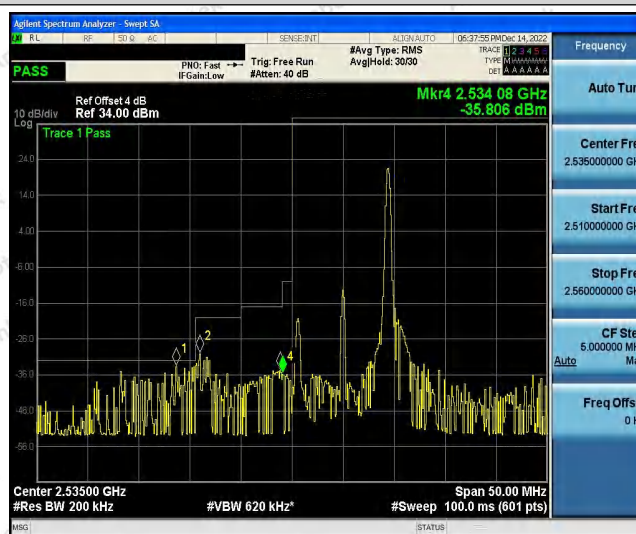

Band41-10MHz-QPSK-40090-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-10MHz-QPSK-41190-1RB#0

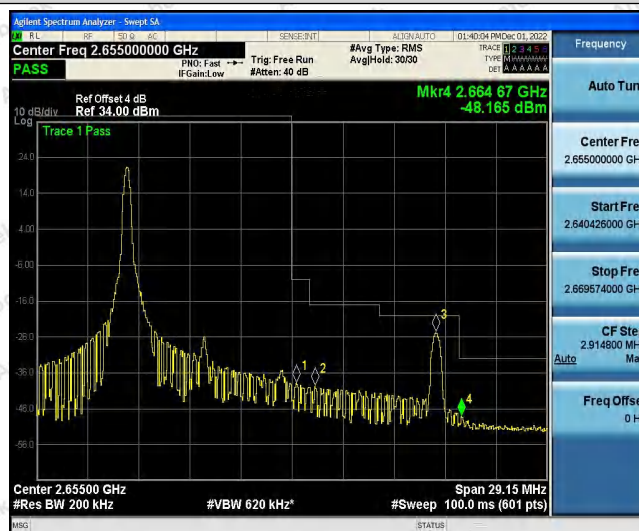

Band41-10MHz-QPSK-41190-1RB#49



Band41-10MHz-QPSK-41190-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-10MHz-16QAM-40090-1RB#0

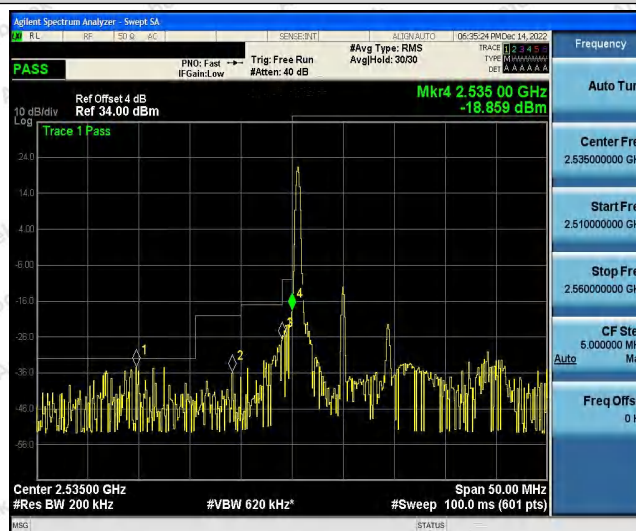

Band41-10MHz-16QAM-40090-1RB#49



Band41-10MHz-16QAM-40090-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-10MHz-16QAM-41190-1RB#0

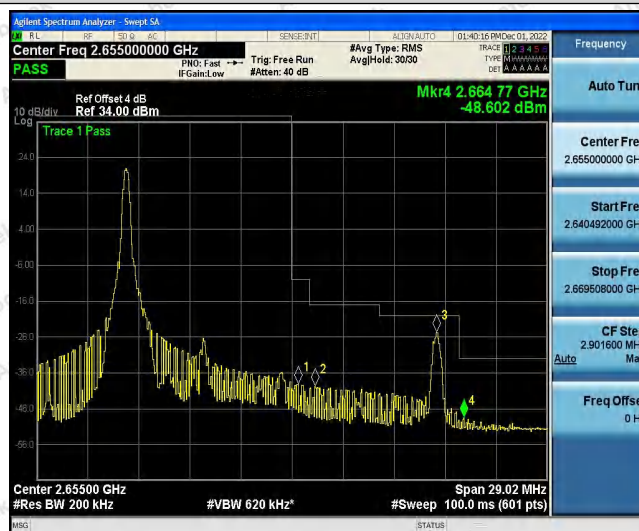

Band41-10MHz-16QAM-41190-1RB#49



Band41-10MHz-16QAM-41190-50RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-15MHz-QPSK-40115-1RB#0

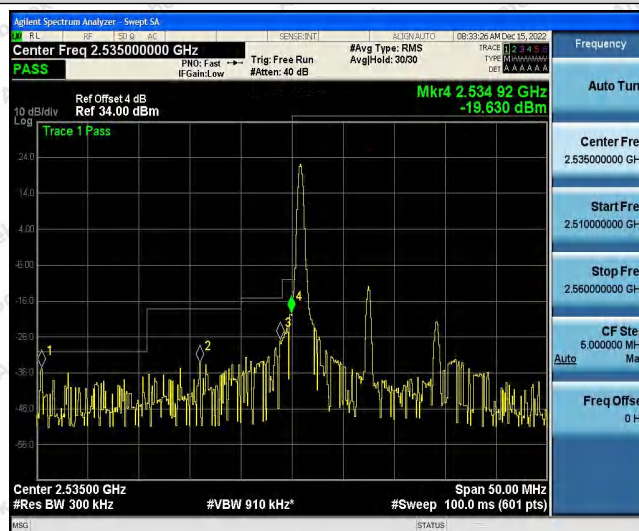

Band41-15MHz-QPSK-40115-1RB#74



Band41-15MHz-QPSK-40115-75RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band41-15MHz-QPSK-41165-1RB#0



Band41-15MHz-QPSK-41165-1RB#74



Band41-15MHz-QPSK-41165-75RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band41-15MHz-16QAM-40115-1RB#0

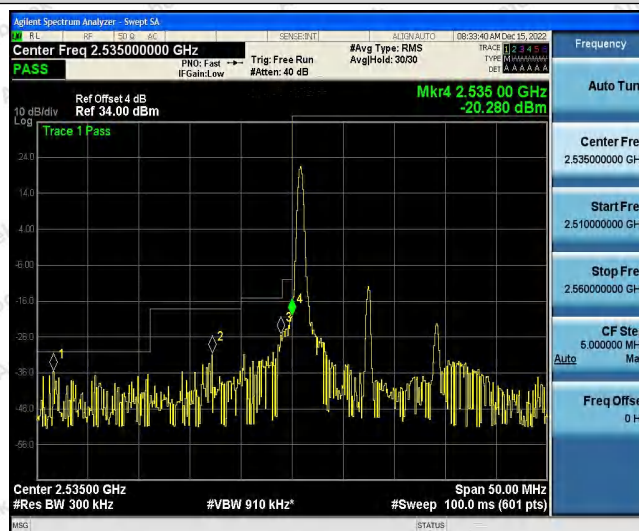

Band41-15MHz-16QAM-40115-1RB#74

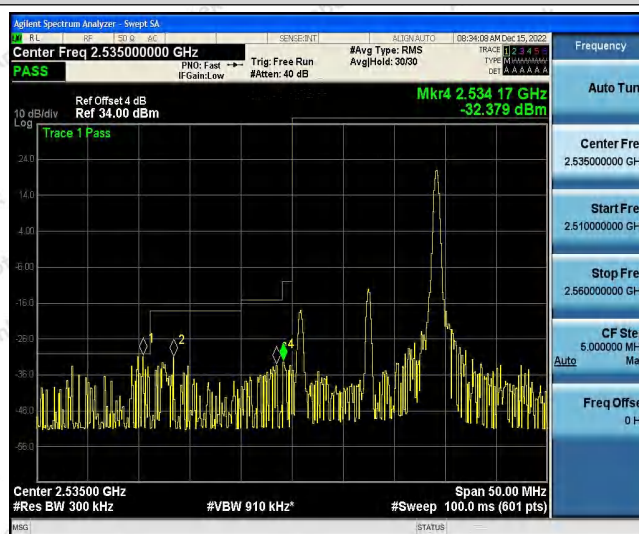

Band41-15MHz-16QAM-40115-75RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-15MHz-16QAM-41165-1RB#0

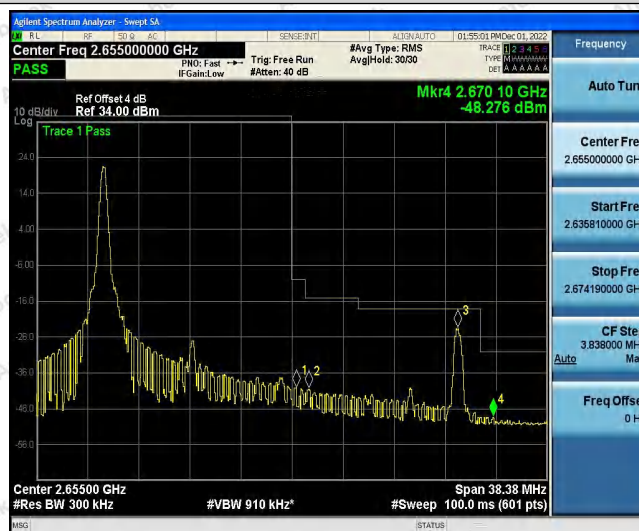

Band41-15MHz-16QAM-41165-1RB#74



Band41-15MHz-16QAM-41165-75RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band41-20MHz-QPSK-40140-1RB#0

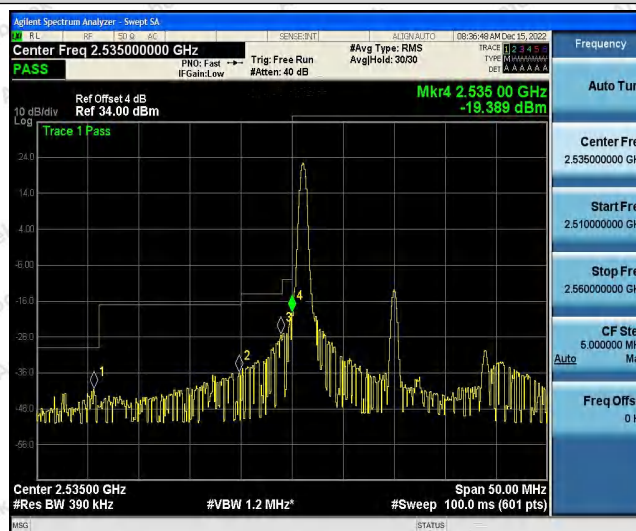

Band41-20MHz-QPSK-40140-1RB#99

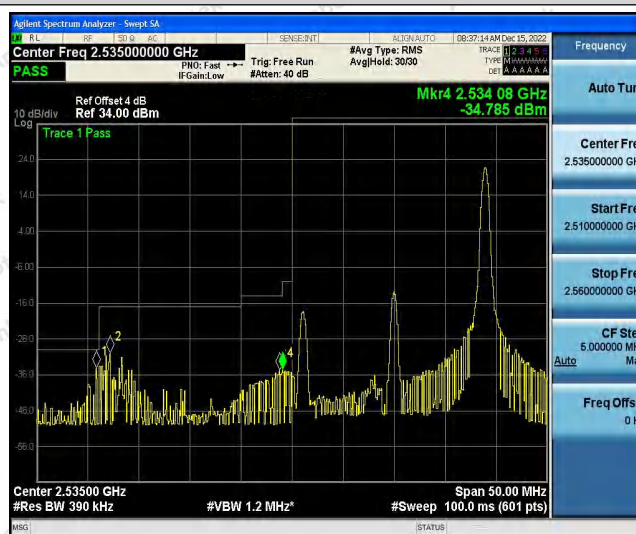

Band41-20MHz-QPSK-40140-100RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-20MHz-QPSK-41140-1RB#0

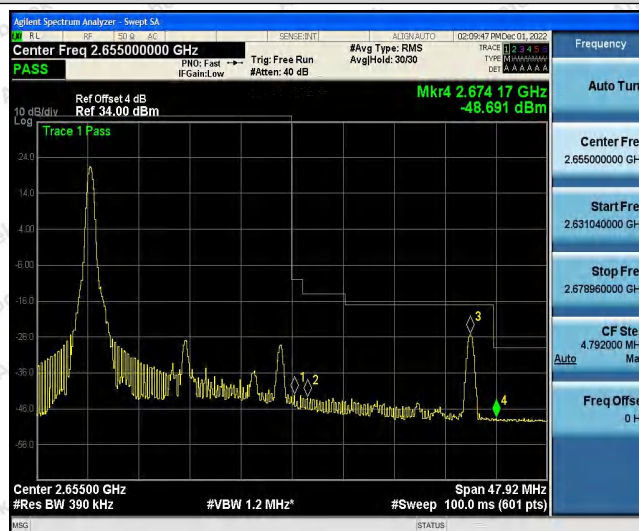

Band41-20MHz-QPSK-41140-1RB#99



Band41-20MHz-QPSK-41140-100RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band41-20MHz-16QAM-40140-1RB#0

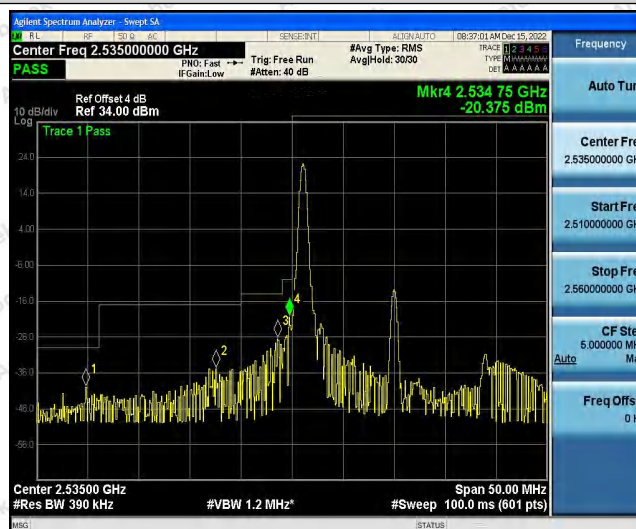

Band41-20MHz-16QAM-40140-1RB#99

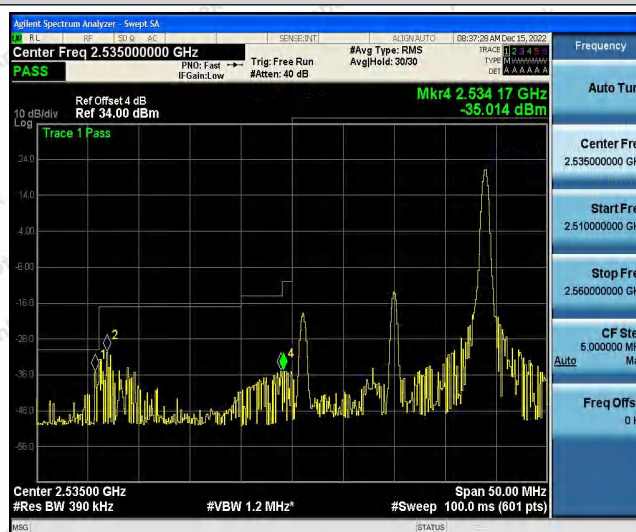

Band41-20MHz-16QAM-40140-100RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




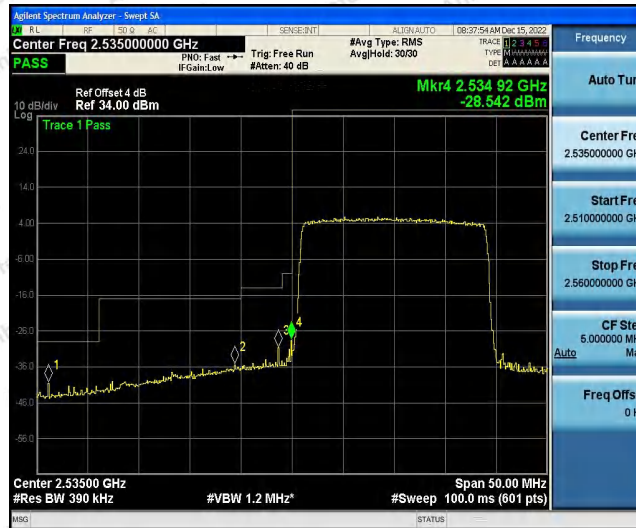

Band41-20MHz-16QAM-41140-1RB#0

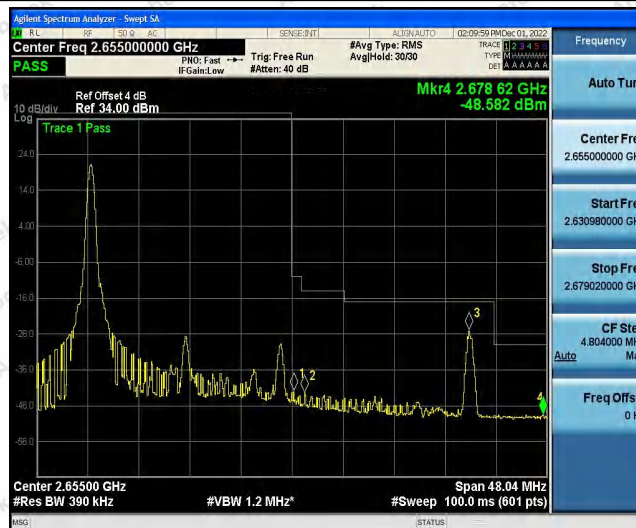

Band41-20MHz-16QAM-41140-1RB#99

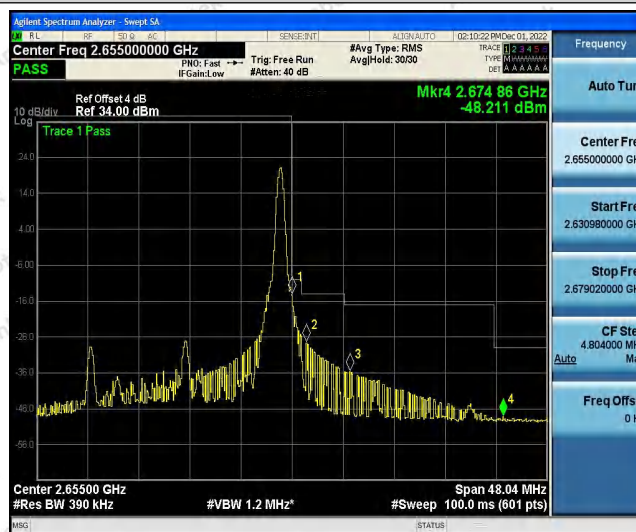

Band41-20MHz-16QAM-41140-100RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	40065	1RB#0	Range1:30~1000MHz	-57.21	PASS
Band41	5MHz	QPSK	40065	1RB#0	Range2:1000~27000MHz	-33.01	PASS
Band41	5MHz	QPSK	40590	1RB#0	Range1:30~1000MHz	-48.13	PASS
Band41	5MHz	QPSK	40590	1RB#0	Range2:1000~27000MHz	-33.59	PASS
Band41	5MHz	QPSK	41215	1RB#0	Range1:30~1000MHz	-48.87	PASS
Band41	5MHz	QPSK	41215	1RB#0	Range2:1000~27000MHz	-33.06	PASS
Band41	5MHz	16QAM	40065	1RB#0	Range1:30~1000MHz	-56.95	PASS
Band41	5MHz	16QAM	40065	1RB#0	Range2:1000~27000MHz	-33.77	PASS
Band41	5MHz	16QAM	40590	1RB#0	Range1:30~1000MHz	-48.12	PASS
Band41	5MHz	16QAM	40590	1RB#0	Range2:1000~27000MHz	-33.5	PASS
Band41	5MHz	16QAM	41215	1RB#0	Range1:30~1000MHz	-48.32	PASS
Band41	5MHz	16QAM	41215	1RB#0	Range2:1000~27000MHz	-34.02	PASS
Band41	10MHz	QPSK	40090	1RB#0	Range1:30~1000MHz	-56.97	PASS
Band41	10MHz	QPSK	40090	1RB#0	Range2:1000~27000MHz	-33.81	PASS
Band41	10MHz	QPSK	40590	1RB#0	Range1:30~1000MHz	-47.93	PASS
Band41	10MHz	QPSK	40590	1RB#0	Range2:1000~27000MHz	-33.34	PASS
Band41	10MHz	QPSK	41190	1RB#0	Range1:30~1000MHz	-48.92	PASS
Band41	10MHz	QPSK	41190	1RB#0	Range2:1000~27000MHz	-33.76	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band41	10MHz	16QAM	40090	1RB#0	Range1:30~1000MHz	-57.17	PASS
Band41	10MHz	16QAM	40090	1RB#0	Range2:1000~27000MHz	-34.01	PASS
Band41	10MHz	16QAM	40590	1RB#0	Range1:30~1000MHz	-48.47	PASS
Band41	10MHz	16QAM	40590	1RB#0	Range2:1000~27000MHz	-33.87	PASS
Band41	10MHz	16QAM	41190	1RB#0	Range1:30~1000MHz	-48.06	PASS
Band41	10MHz	16QAM	41190	1RB#0	Range2:1000~27000MHz	-33.55	PASS
Band41	15MHz	QPSK	40115	1RB#0	Range1:30~1000MHz	-57.16	PASS
Band41	15MHz	QPSK	40115	1RB#0	Range2:1000~27000MHz	-33.47	PASS
Band41	15MHz	QPSK	40590	1RB#0	Range1:30~1000MHz	-48.53	PASS
Band41	15MHz	QPSK	40590	1RB#0	Range2:1000~27000MHz	-33.02	PASS
Band41	15MHz	QPSK	41165	1RB#0	Range1:30~1000MHz	-47.98	PASS
Band41	15MHz	QPSK	41165	1RB#0	Range2:1000~27000MHz	-33.77	PASS
Band41	15MHz	16QAM	40115	1RB#0	Range1:30~1000MHz	-57.54	PASS
Band41	15MHz	16QAM	40115	1RB#0	Range2:1000~27000MHz	-33.92	PASS
Band41	15MHz	16QAM	40590	1RB#0	Range1:30~1000MHz	-47.33	PASS
Band41	15MHz	16QAM	40590	1RB#0	Range2:1000~27000MHz	-33.27	PASS
Band41	15MHz	16QAM	41165	1RB#0	Range1:30~1000MHz	-48.88	PASS
Band41	15MHz	16QAM	41165	1RB#0	Range2:1000~27000MHz	-33.83	PASS
Band41	20MHz	QPSK	40140	1RB#0	Range1:30~1000MHz	-57.04	PASS
Band41	20MHz	QPSK	40140	1RB#0	Range2:1000~27000MHz	-33.94	PASS
Band41	20MHz	QPSK	40590	1RB#0	Range1:30~1000MHz	-47.02	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band41	20MHz	QPSK	40590	1RB#0	Range2:1000~27000MHz	-33.2	PASS
Band41	20MHz	QPSK	41140	1RB#0	Range1:30~1000MHz	-47.97	PASS
Band41	20MHz	QPSK	41140	1RB#0	Range2:1000~27000MHz	-33.56	PASS
Band41	20MHz	16QAM	40140	1RB#0	Range1:30~1000MHz	-56.91	PASS
Band41	20MHz	16QAM	40140	1RB#0	Range2:1000~27000MHz	-33.54	PASS
Band41	20MHz	16QAM	40590	1RB#0	Range1:30~1000MHz	-47.22	PASS
Band41	20MHz	16QAM	40590	1RB#0	Range2:1000~27000MHz	-33.11	PASS
Band41	20MHz	16QAM	41140	1RB#0	Range1:30~1000MHz	-47.45	PASS
Band41	20MHz	16QAM	41140	1RB#0	Range2:1000~27000MHz	-33.96	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn



Test Graphs

Band41-5MHz-QPSK-40065-1RB#0-Range1:30~1000MHz

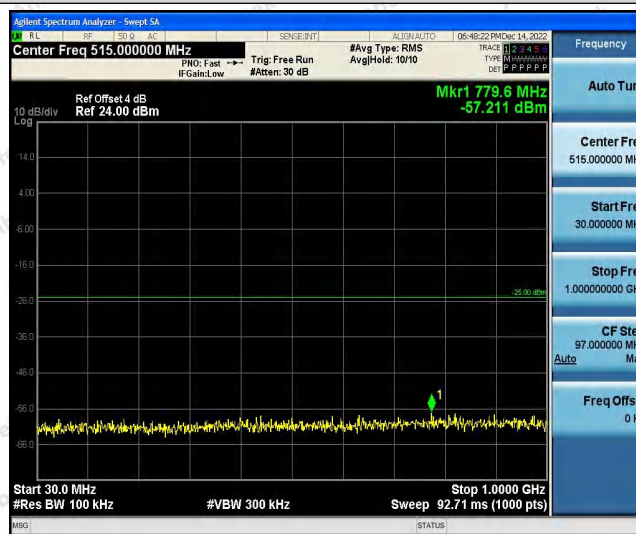

Band41-5MHz-QPSK-40065-1RB#0-Range2:1000~27000MHz



Band41-5MHz-QPSK-40590-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




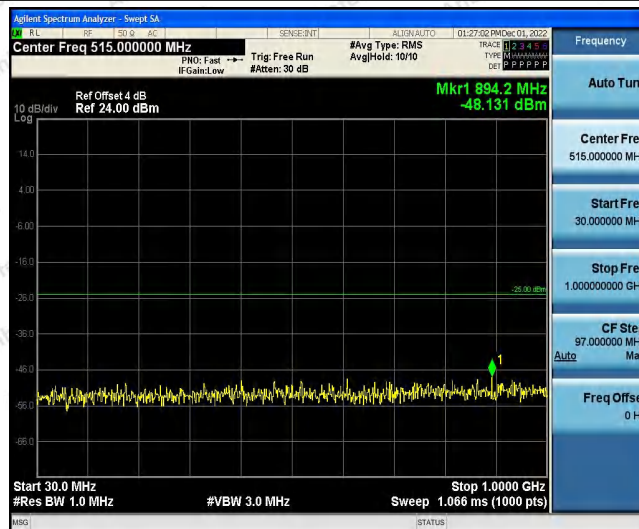

Band41-5MHz-QPSK-40590-1RB#0-Range2:1000~27000MHz



Band41-5MHz-QPSK-41215-1RB#0-Range1:30~1000MHz

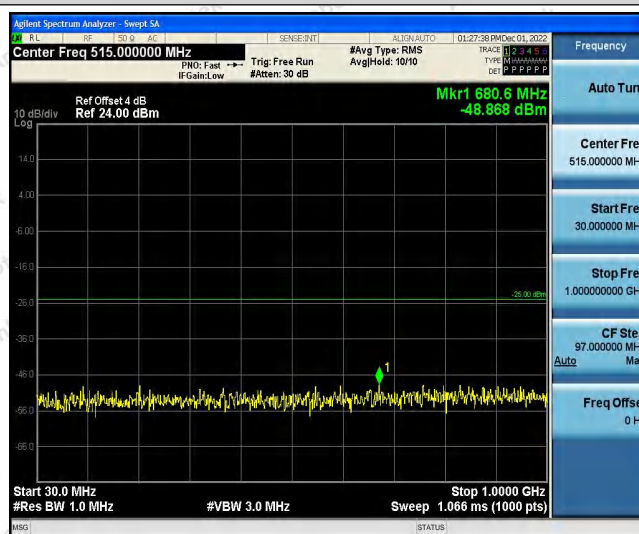

Band41-5MHz-QPSK-41215-1RB#0-Range2:1000~27000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-5MHz-16QAM-40065-1RB#0-Range1:30~1000MHz

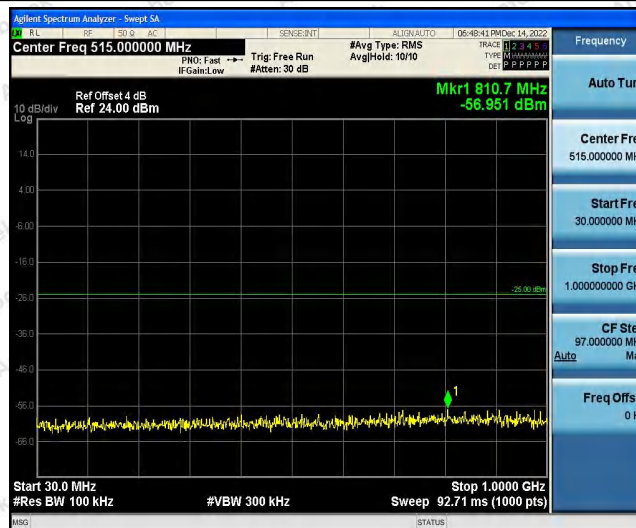

Band41-5MHz-16QAM-40065-1RB#0-Range2: 1000~27000MHz



Band41-5MHz-16QAM-40590-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




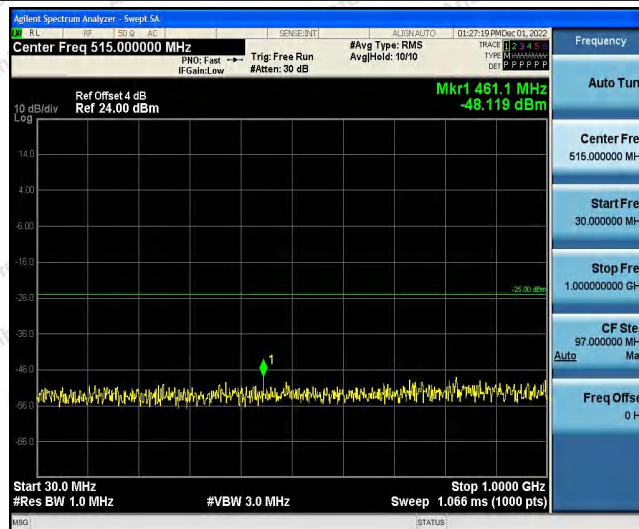

Band41-5MHz-16QAM-40590-1RB#0-Range2:1000~27000MHz



Band41-5MHz-16QAM-41215-1RB#0-Range1:30~1000MHz

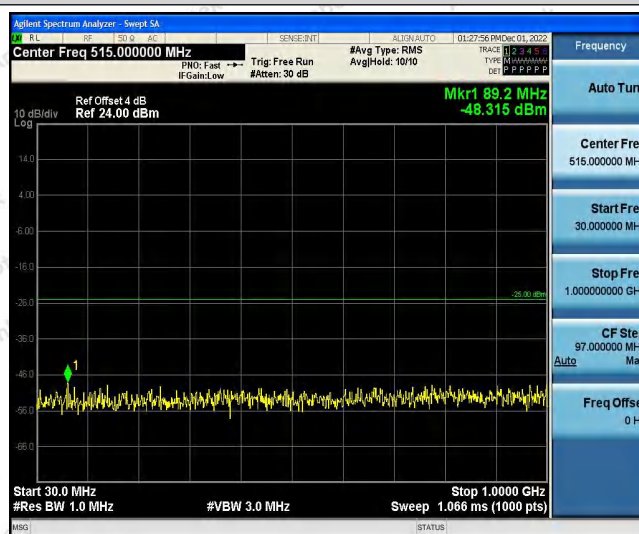

Band41-5MHz-16QAM-41215-1RB#0-Range2:1000~27000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-10MHz-QPSK-40090-1RB#0-Range1:30~1000MHz

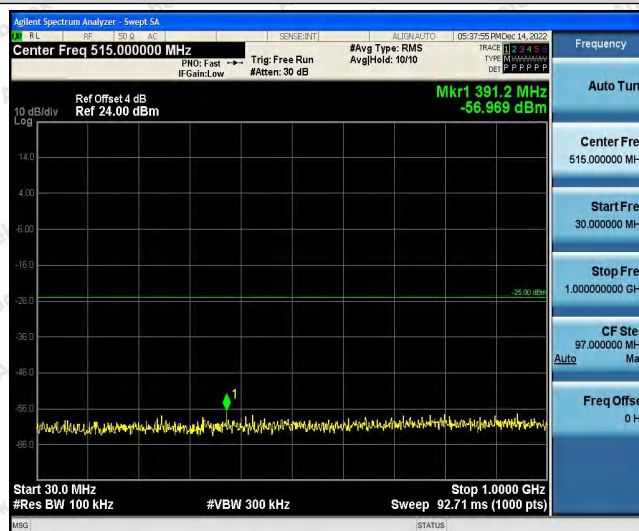

Band41-10MHz-QPSK-40090-1RB#0-Range2: 1000~27000MHz



Band41-10MHz-QPSK-40590-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




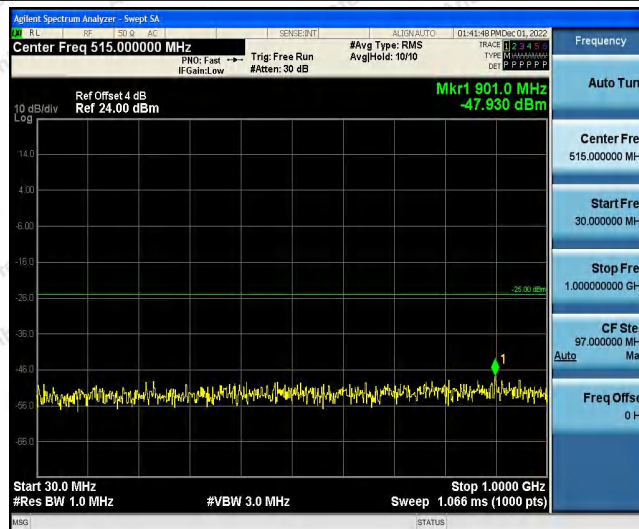

Band41-10MHz-QPSK-40590-1RB#0-Range2:1000~27000MHz



Band41-10MHz-QPSK-41190-1RB#0-Range1:30~1000MHz

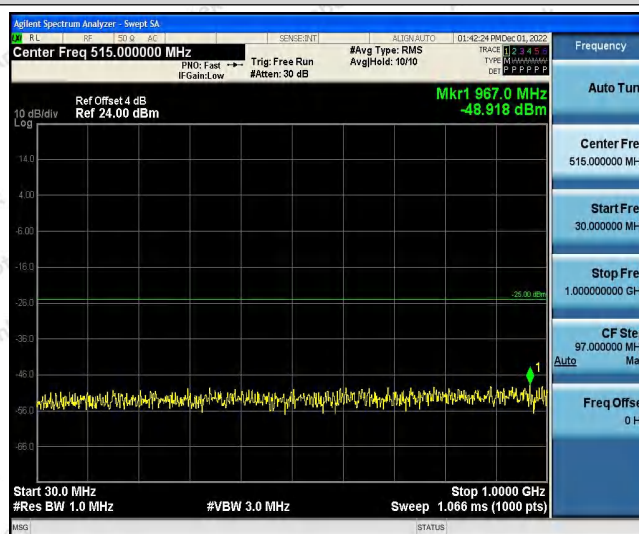

Band41-10MHz-QPSK-41190-1RB#0-Range2:1000~27000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-10MHz-16QAM-40090-1RB#0-Range1:30~1000MHz

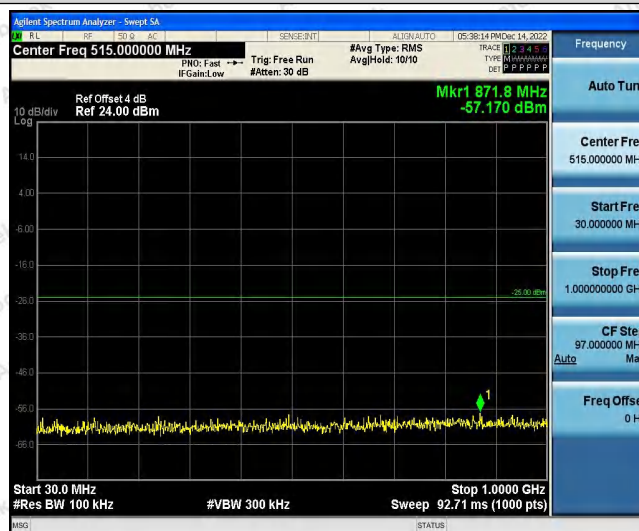

Band41-10MHz-16QAM-40090-1RB#0-Range2:1000~27000MHz



Band41-10MHz-16QAM-40590-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




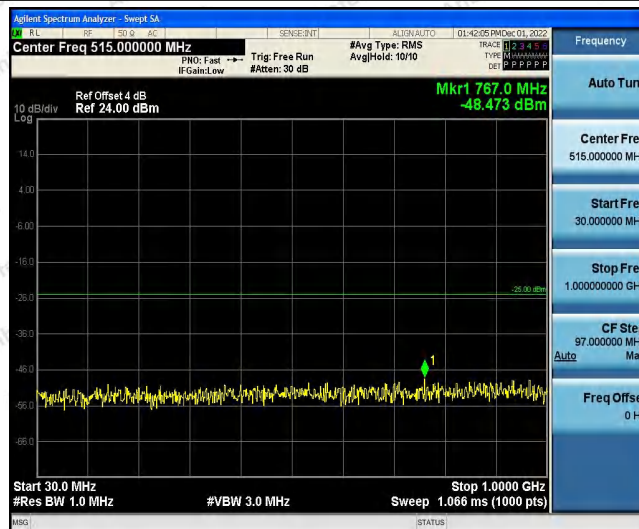

Band41-10MHz-16QAM-40590-1RB#0-Range2:1000~27000MHz



Band41-10MHz-16QAM-41190-1RB#0-Range1:30~1000MHz

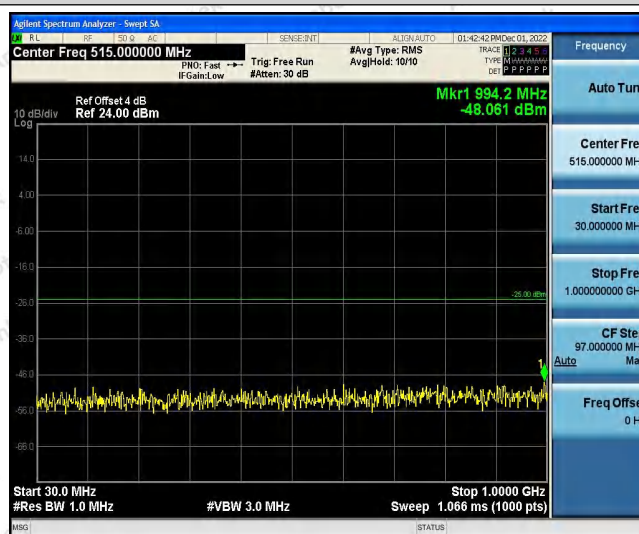

Band41-10MHz-16QAM-41190-1RB#0-Range2:1000~27000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-15MHz-QPSK-40115-1RB#0-Range1:30~1000MHz

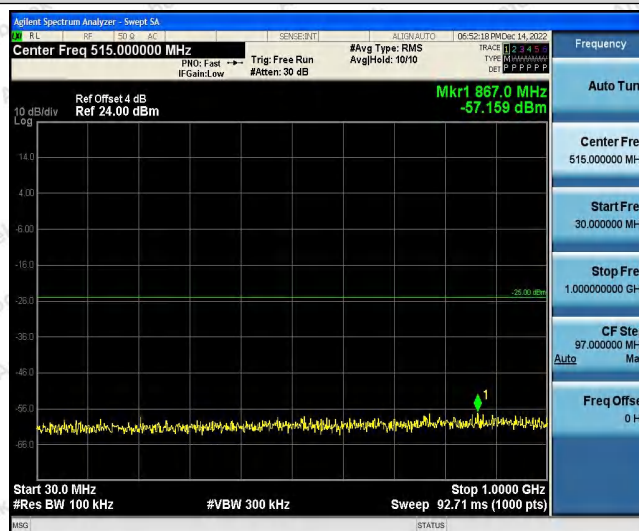

Band41-15MHz-QPSK-40115-1RB#0-Range2: 1000~27000MHz



Band41-15MHz-QPSK-40590-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




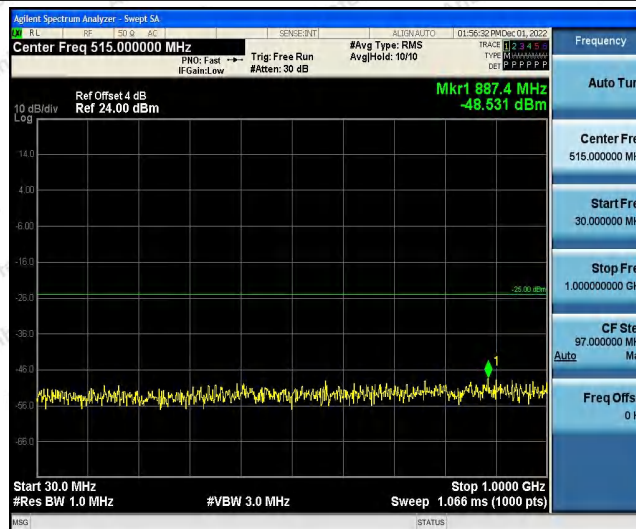

Band41-15MHz-QPSK-40590-1RB#0-Range2:1000~27000MHz



Band41-15MHz-QPSK-41165-1RB#0-Range1:30~1000MHz

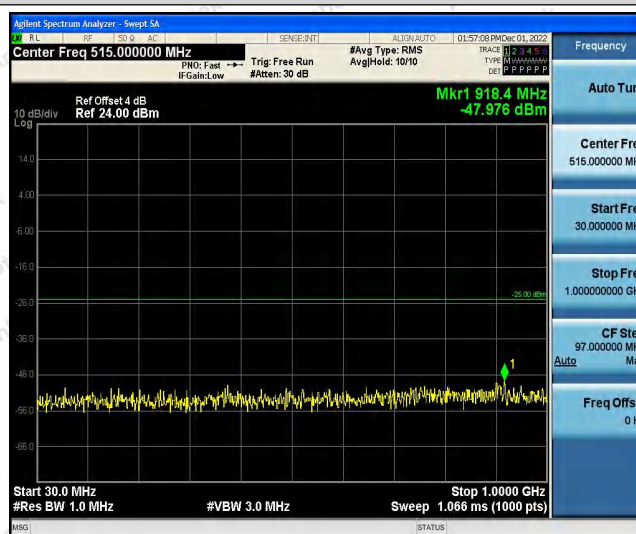

Band41-15MHz-QPSK-41165-1RB#0-Range2:1000~27000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-15MHz-16QAM-40115-1RB#0-Range1:30~1000MHz

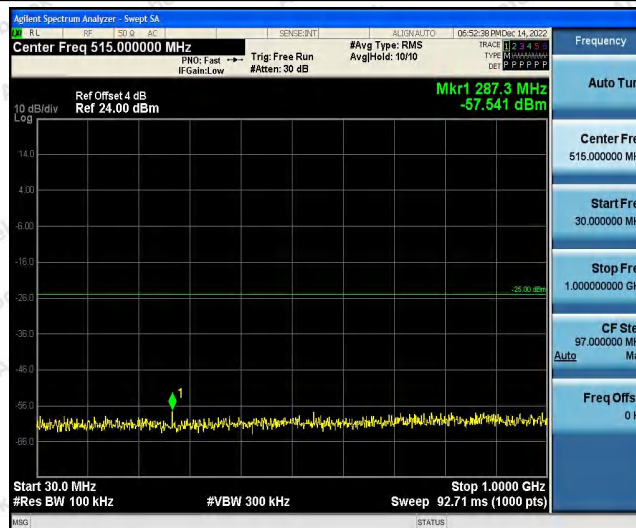

Band41-15MHz-16QAM-40115-1RB#0-Range2:1000~27000MHz



Band41-15MHz-16QAM-40590-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




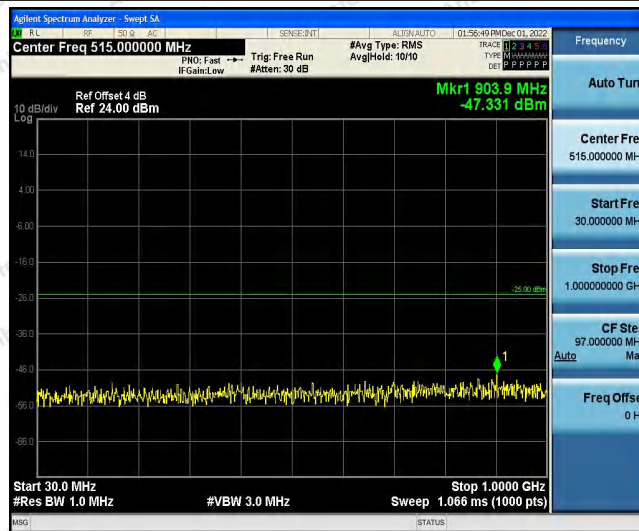

Band41-15MHz-16QAM-40590-1RB#0-Range2:1000~27000MHz



Band41-15MHz-16QAM-41165-1RB#0-Range1:30~1000MHz

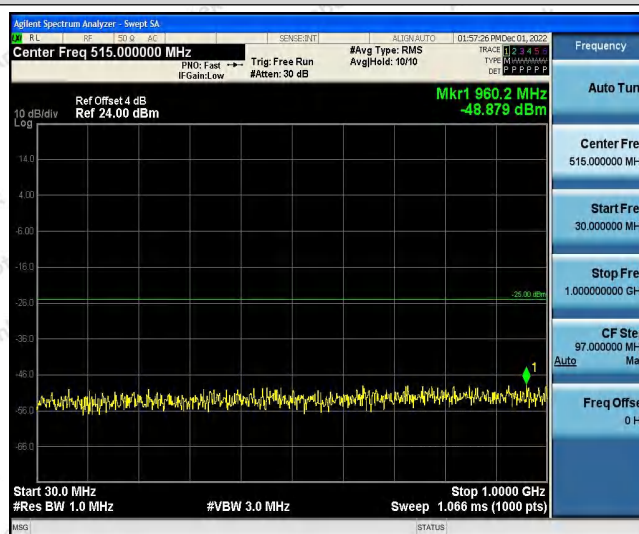

Band41-15MHz-16QAM-41165-1RB#0-Range2:1000~27000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn





Band41-20MHz-QPSK-40140-1RB#0-Range1:30~1000MHz

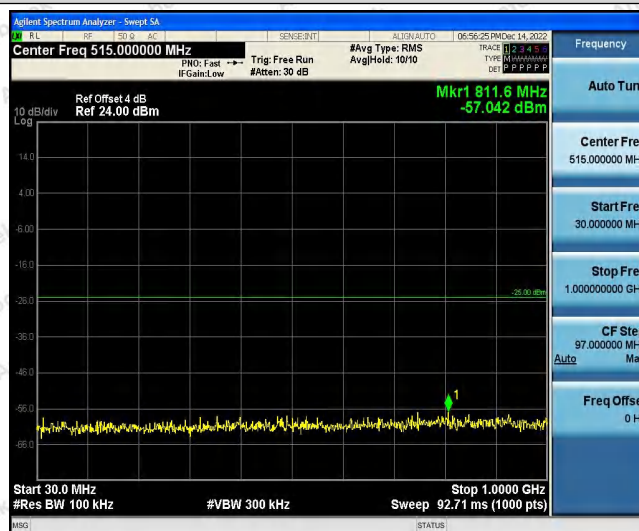

Band41-20MHz-QPSK-40140-1RB#0-Range2: 1000~27000MHz



Band41-20MHz-QPSK-40590-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




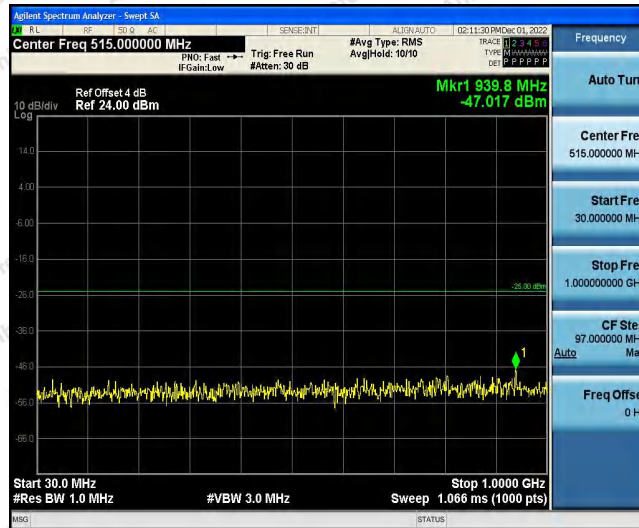

Band41-20MHz-QPSK-40590-1RB#0-Range2:1000~27000MHz



Band41-20MHz-QPSK-41140-1RB#0-Range1:30~1000MHz

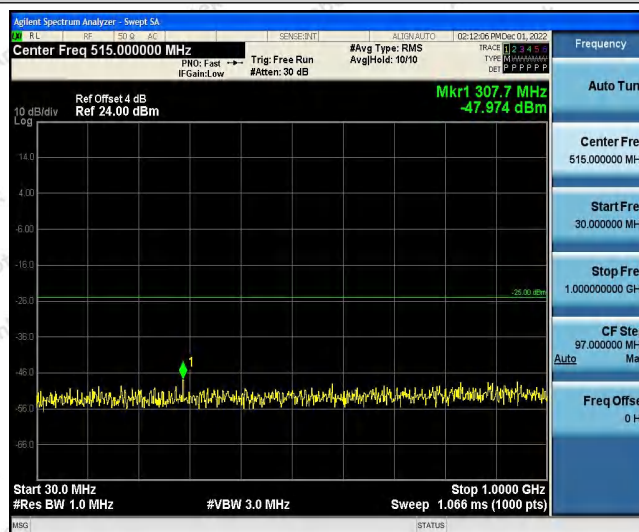

Band41-20MHz-QPSK-41140-1RB#0-Range2:1000~27000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



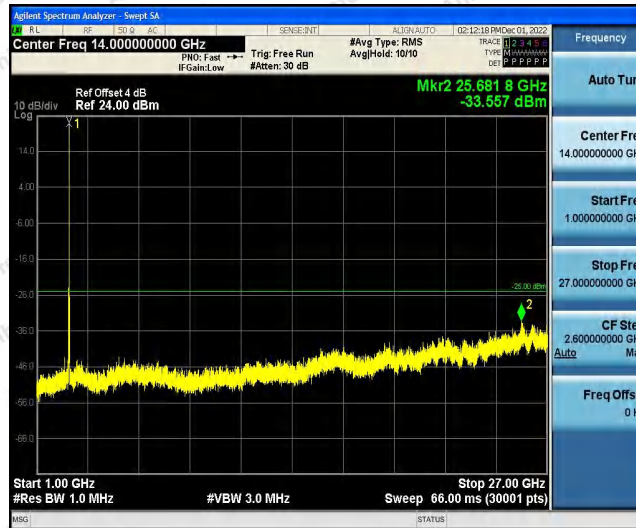

Band41-20MHz-16QAM-40140-1RB#0-Range1:30~1000MHz

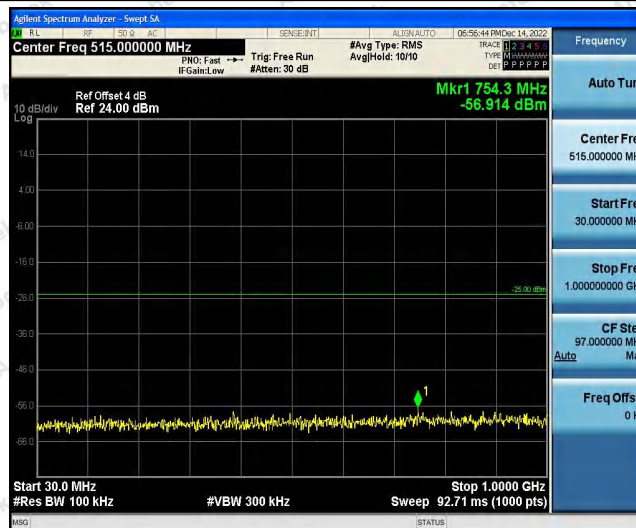

Band41-20MHz-16QAM-40140-1RB#0-Range2:1000~27000MHz



Band41-20MHz-16QAM-40590-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




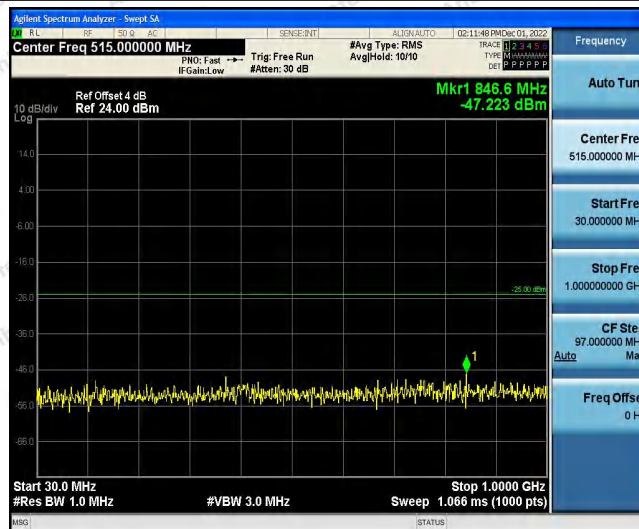

Band41-20MHz-16QAM-40590-1RB#0-Range2:1000~27000MHz



Band41-20MHz-16QAM-41140-1RB#0-Range1:30~1000MHz

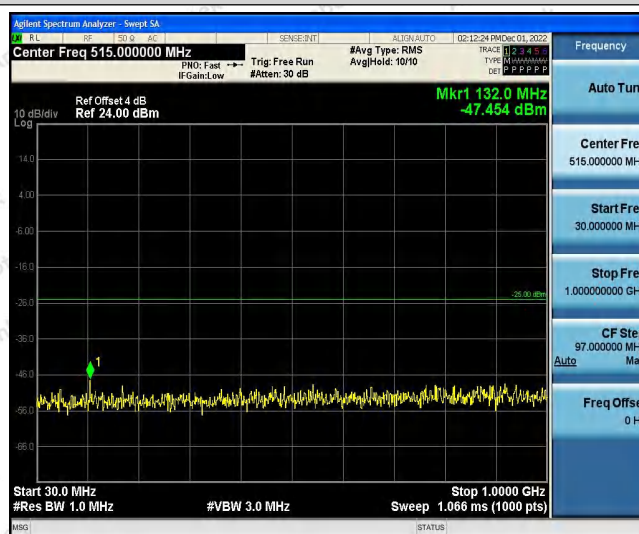

Band41-20MHz-16QAM-41140-1RB#0-Range2:1000~27000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

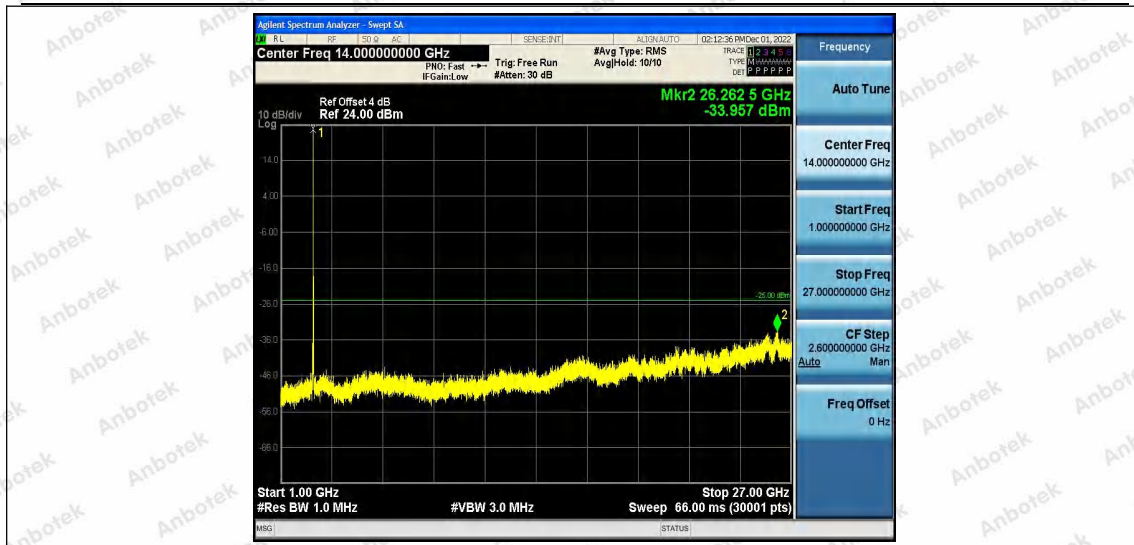

**Shenzhen Anbotek Compliance Laboratory Limited**

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage					
					Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band41	5MHz	QPSK	40065	25RB#0	VL	NT	10.04	0.003957	±2.5	PASS
Band41	5MHz	QPSK	40065	25RB#0	VN	NT	9.01	0.003551	±2.5	PASS
Band41	5MHz	QPSK	40065	25RB#0	VH	NT	5.35	0.002108	±2.5	PASS
Band41	5MHz	QPSK	40590	25RB#0	VL	NT	-12.80	-0.004942	±2.5	PASS
Band41	5MHz	QPSK	40590	25RB#0	VN	NT	-11.10	-0.004286	±2.5	PASS
Band41	5MHz	QPSK	40590	25RB#0	VH	NT	-11.89	-0.004591	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	VL	NT	5.55	0.002092	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	VN	NT	14.25	0.005372	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	VH	NT	-15.21	-0.005734	±2.5	PASS
Band41	5MHz	16QAM	40065	25RB#0	VL	NT	8.33	0.003283	±2.5	PASS
Band41	5MHz	16QAM	40065	25RB#0	VN	NT	-6.27	-0.002471	±2.5	PASS
Band41	5MHz	16QAM	40065	25RB#0	VH	NT	-9.04	-0.003563	±2.5	PASS
Band41	5MHz	16QAM	40590	25RB#0	VL	NT	-9.34	-0.003606	±2.5	PASS
Band41	5MHz	16QAM	40590	25RB#0	VN	NT	5.68	0.002193	±2.5	PASS
Band41	5MHz	16QAM	40590	25RB#0	VH	NT	-8.91	-0.003440	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	VL	NT	-10.07	-0.003796	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	VN	NT	-10.94	-0.004124	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	VH	NT	-6.22	-0.002345	±2.5	PASS
Band41	10MHz	QPSK	40090	50RB#0	VL	NT	5.69	0.002240	±2.5	PASS
Band41	10MHz	QPSK	40090	50RB#0	VN	NT	9.78	0.003850	±2.5	PASS
Band41	10MHz	QPSK	40090	50RB#0	VH	NT	7.52	0.002961	±2.5	PASS
Band41	10MHz	QPSK	40590	50RB#0	VL	NT	-14.22	-0.005490	±2.5	PASS
Band41	10MHz	QPSK	40590	50RB#0	VN	NT	7.17	0.002768	±2.5	PASS
Band41	10MHz	QPSK	40590	50RB#0	VH	NT	-8.03	-0.003100	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	VL	NT	-10.80	-0.004075	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	VN	NT	5.14	0.001940	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	VH	NT	8.43	0.003181	±2.5	PASS
Band41	10MHz	16QAM	40090	50RB#0	VL	NT	11.23	0.004421	±2.5	PASS
Band41	10MHz	16QAM	40090	50RB#0	VN	NT	9.21	0.003626	±2.5	PASS
Band41	10MHz	16QAM	40090	50RB#0	VH	NT	6.11	0.002406	±2.5	PASS
Band41	10MHz	16QAM	40590	50RB#0	VL	NT	-7.84	-0.003027	±2.5	PASS
Band41	10MHz	16QAM	40590	50RB#0	VN	NT	-12.13	-0.004683	±2.5	PASS
Band41	10MHz	16QAM	40590	50RB#0	VH	NT	-16.49	-0.006367	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	VL	NT	-7.82	-0.002951	±2.5	PASS



Band41	10MHz	16QAM	41190	50RB#0	VN	NT	-7.01	-0.002645	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	VH	NT	-6.31	-0.002381	±2.5	PASS
Band41	15MHz	QPSK	40115	75RB#0	VL	NT	-6.42	-0.002525	±2.5	PASS
Band41	15MHz	QPSK	40115	75RB#0	VN	NT	-2.23	-0.000877	±2.5	PASS
Band41	15MHz	QPSK	40115	75RB#0	VH	NT	-7.44	-0.002926	±2.5	PASS
Band41	15MHz	QPSK	40590	75RB#0	VL	NT	-15.71	-0.006066	±2.5	PASS
Band41	15MHz	QPSK	40590	75RB#0	VN	NT	7.58	0.002927	±2.5	PASS
Band41	15MHz	QPSK	40590	75RB#0	VH	NT	-9.63	-0.003718	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	VL	NT	-6.77	-0.002557	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	VN	NT	-10.50	-0.003966	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	VH	NT	-11.01	-0.004159	±2.5	PASS
Band41	15MHz	16QAM	40115	75RB#0	VL	NT	4.59	0.001805	±2.5	PASS
Band41	15MHz	16QAM	40115	75RB#0	VN	NT	-13.40	-0.005270	±2.5	PASS
Band41	15MHz	16QAM	40115	75RB#0	VH	NT	-10.10	-0.003972	±2.5	PASS
Band41	15MHz	16QAM	40590	75RB#0	VL	NT	-14.52	-0.005606	±2.5	PASS
Band41	15MHz	16QAM	40590	75RB#0	VN	NT	-11.46	-0.004425	±2.5	PASS
Band41	15MHz	16QAM	40590	75RB#0	VH	NT	-12.97	-0.005008	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	VL	NT	-14.06	-0.005311	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	VN	NT	-16.29	-0.006153	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	VH	NT	-14.72	-0.005560	±2.5	PASS
Band41	20MHz	QPSK	40140	100RB#0	VL	NT	-7.58	-0.002978	±2.5	PASS
Band41	20MHz	QPSK	40140	100RB#0	VN	NT	9.47	0.003721	±2.5	PASS
Band41	20MHz	QPSK	40140	100RB#0	VH	NT	5.95	0.002338	±2.5	PASS
Band41	20MHz	QPSK	40590	100RB#0	VL	NT	-10.63	-0.004104	±2.5	PASS
Band41	20MHz	QPSK	40590	100RB#0	VN	NT	6.45	0.002490	±2.5	PASS
Band41	20MHz	QPSK	40590	100RB#0	VH	NT	-10.41	-0.004019	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	VL	NT	-17.70	-0.006692	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	VN	NT	1.75	0.000662	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	VH	NT	-16.88	-0.006382	±2.5	PASS
Band41	20MHz	16QAM	40140	100RB#0	VL	NT	8.53	0.003352	±2.5	PASS
Band41	20MHz	16QAM	40140	100RB#0	VN	NT	8.64	0.003395	±2.5	PASS
Band41	20MHz	16QAM	40140	100RB#0	VH	NT	13.55	0.005324	±2.5	PASS
Band41	20MHz	16QAM	40590	100RB#0	VL	NT	-8.48	-0.003274	±2.5	PASS
Band41	20MHz	16QAM	40590	100RB#0	VN	NT	-6.14	-0.002371	±2.5	PASS
Band41	20MHz	16QAM	40590	100RB#0	VH	NT	-10.50	-0.004054	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	VL	NT	-9.91	-0.003747	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	VN	NT	-16.05	-0.006068	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	VH	NT	-15.92	-0.006019	±2.5	PASS



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band41	5MHz	QPSK	40065	25RB#0	NV	-30	6.51	0.002566	±2.5	PASS
Band41	5MHz	QPSK	40065	25RB#0	NV	-20	6.74	0.002656	±2.5	PASS
Band41	5MHz	QPSK	40065	25RB#0	NV	0	9.41	0.003708	±2.5	PASS
Band41	5MHz	QPSK	40065	25RB#0	NV	10	7.60	0.002995	±2.5	PASS
Band41	5MHz	QPSK	40065	25RB#0	NV	20	10.93	0.004307	±2.5	PASS
Band41	5MHz	QPSK	40590	25RB#0	NV	-30	-6.05	-0.002336	±2.5	PASS
Band41	5MHz	QPSK	40590	25RB#0	NV	-20	-6.91	-0.002668	±2.5	PASS
Band41	5MHz	QPSK	40590	25RB#0	NV	0	-7.15	-0.002761	±2.5	PASS
Band41	5MHz	QPSK	40590	25RB#0	NV	10	-8.64	-0.003336	±2.5	PASS
Band41	5MHz	QPSK	40590	25RB#0	NV	20	7.71	0.002977	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	NV	-30	-7.05	-0.002658	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	NV	-20	3.08	0.001161	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	NV	0	9.51	0.003585	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	NV	10	-9.37	-0.003533	±2.5	PASS
Band41	5MHz	QPSK	41215	25RB#0	NV	20	-3.18	-0.001199	±2.5	PASS
Band41	5MHz	16QAM	40065	25RB#0	NV	-30	5.59	0.002203	±2.5	PASS
Band41	5MHz	16QAM	40065	25RB#0	NV	-20	4.06	0.001600	±2.5	PASS
Band41	5MHz	16QAM	40065	25RB#0	NV	0	9.88	0.003894	±2.5	PASS
Band41	5MHz	16QAM	40065	25RB#0	NV	10	11.06	0.004359	±2.5	PASS
Band41	5MHz	16QAM	40065	25RB#0	NV	20	8.64	0.003405	±2.5	PASS
Band41	5MHz	16QAM	40590	25RB#0	NV	-30	5.94	0.002293	±2.5	PASS
Band41	5MHz	16QAM	40590	25RB#0	NV	-20	-5.41	-0.002089	±2.5	PASS
Band41	5MHz	16QAM	40590	25RB#0	NV	0	-8.03	-0.003100	±2.5	PASS
Band41	5MHz	16QAM	40590	25RB#0	NV	10	-5.91	-0.002282	±2.5	PASS
Band41	5MHz	16QAM	40590	25RB#0	NV	20	-5.87	-0.002266	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	NV	-30	3.83	0.001444	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	NV	-20	-10.07	-0.003796	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	NV	0	-3.65	-0.001376	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	NV	10	-9.74	-0.003672	±2.5	PASS
Band41	5MHz	16QAM	41215	25RB#0	NV	20	-8.00	-0.003016	±2.5	PASS
Band41	10MHz	QPSK	40090	50RB#0	NV	-30	6.21	0.002445	±2.5	PASS
Band41	10MHz	QPSK	40090	50RB#0	NV	-20	4.72	0.001858	±2.5	PASS
Band41	10MHz	QPSK	40090	50RB#0	NV	0	6.17	0.002429	±2.5	PASS
Band41	10MHz	QPSK	40090	50RB#0	NV	10	8.74	0.003441	±2.5	PASS



Band41	10MHz	QPSK	40090	50RB#0	NV	20	6.65	0.002618	±2.5	PASS
Band41	10MHz	QPSK	40590	50RB#0	NV	-30	-5.68	-0.002193	±2.5	PASS
Band41	10MHz	QPSK	40590	50RB#0	NV	-20	-8.98	-0.003467	±2.5	PASS
Band41	10MHz	QPSK	40590	50RB#0	NV	0	9.27	0.003579	±2.5	PASS
Band41	10MHz	QPSK	40590	50RB#0	NV	10	-8.65	-0.003340	±2.5	PASS
Band41	10MHz	QPSK	40590	50RB#0	NV	20	-10.09	-0.003896	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	NV	-30	-8.61	-0.003249	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	NV	-20	-7.41	-0.002796	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	NV	0	-6.84	-0.002581	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	NV	10	-12.12	-0.004574	±2.5	PASS
Band41	10MHz	QPSK	41190	50RB#0	NV	20	-12.65	-0.004774	±2.5	PASS
Band41	10MHz	16QAM	40090	50RB#0	NV	-30	9.56	0.003764	±2.5	PASS
Band41	10MHz	16QAM	40090	50RB#0	NV	-20	7.00	0.002756	±2.5	PASS
Band41	10MHz	16QAM	40090	50RB#0	NV	0	11.33	0.004461	±2.5	PASS
Band41	10MHz	16QAM	40090	50RB#0	NV	10	8.84	0.003480	±2.5	PASS
Band41	10MHz	16QAM	40090	50RB#0	NV	20	9.31	0.003665	±2.5	PASS
Band41	10MHz	16QAM	40590	50RB#0	NV	-30	-13.12	-0.005066	±2.5	PASS
Band41	10MHz	16QAM	40590	50RB#0	NV	-20	3.02	0.001166	±2.5	PASS
Band41	10MHz	16QAM	40590	50RB#0	NV	0	-18.50	-0.007143	±2.5	PASS
Band41	10MHz	16QAM	40590	50RB#0	NV	10	-8.87	-0.003425	±2.5	PASS
Band41	10MHz	16QAM	40590	50RB#0	NV	20	-12.73	-0.004915	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	NV	-30	-8.71	-0.003287	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	NV	-20	-11.82	-0.004460	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	NV	0	-12.72	-0.004800	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	NV	10	5.65	0.002132	±2.5	PASS
Band41	10MHz	16QAM	41190	50RB#0	NV	20	-13.56	-0.005117	±2.5	PASS
Band41	15MHz	QPSK	40115	75RB#0	NV	-30	-8.96	-0.003524	±2.5	PASS
Band41	15MHz	QPSK	40115	75RB#0	NV	-20	-8.43	-0.003316	±2.5	PASS
Band41	15MHz	QPSK	40115	75RB#0	NV	0	-10.43	-0.004102	±2.5	PASS
Band41	15MHz	QPSK	40115	75RB#0	NV	10	-9.33	-0.003670	±2.5	PASS
Band41	15MHz	QPSK	40115	75RB#0	NV	20	-9.21	-0.003622	±2.5	PASS
Band41	15MHz	QPSK	40590	75RB#0	NV	-30	-14.25	-0.005502	±2.5	PASS
Band41	15MHz	QPSK	40590	75RB#0	NV	-20	-13.28	-0.005127	±2.5	PASS
Band41	15MHz	QPSK	40590	75RB#0	NV	0	-13.40	-0.005174	±2.5	PASS
Band41	15MHz	QPSK	40590	75RB#0	NV	10	-4.48	-0.001730	±2.5	PASS
Band41	15MHz	QPSK	40590	75RB#0	NV	20	-10.27	-0.003965	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	NV	-30	-14.26	-0.005386	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	NV	-20	-11.01	-0.004159	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	NV	0	-14.55	-0.005496	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	NV	10	-13.50	-0.005099	±2.5	PASS
Band41	15MHz	QPSK	41165	75RB#0	NV	20	-13.16	-0.004971	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band41	15MHz	16QAM	40115	75RB#0	NV	-30	-12.83	-0.005046	±2.5	PASS
Band41	15MHz	16QAM	40115	75RB#0	NV	-20	-6.22	-0.002446	±2.5	PASS
Band41	15MHz	16QAM	40115	75RB#0	NV	0	-6.82	-0.002682	±2.5	PASS
Band41	15MHz	16QAM	40115	75RB#0	NV	10	-9.07	-0.003567	±2.5	PASS
Band41	15MHz	16QAM	40115	75RB#0	NV	20	-7.14	-0.002808	±2.5	PASS
Band41	15MHz	16QAM	40590	75RB#0	NV	-30	-5.09	-0.001965	±2.5	PASS
Band41	15MHz	16QAM	40590	75RB#0	NV	-20	-11.27	-0.004351	±2.5	PASS
Band41	15MHz	16QAM	40590	75RB#0	NV	0	-11.23	-0.004336	±2.5	PASS
Band41	15MHz	16QAM	40590	75RB#0	NV	10	-9.94	-0.003838	±2.5	PASS
Band41	15MHz	16QAM	40590	75RB#0	NV	20	-11.63	-0.004490	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	NV	-30	-17.11	-0.006463	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	NV	-20	-13.30	-0.005024	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	NV	0	-16.59	-0.006266	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	NV	10	-14.12	-0.005333	±2.5	PASS
Band41	15MHz	16QAM	41165	75RB#0	NV	20	-18.44	-0.006965	±2.5	PASS
Band41	20MHz	QPSK	40140	100RB#0	NV	-30	7.17	0.002817	±2.5	PASS
Band41	20MHz	QPSK	40140	100RB#0	NV	-20	-6.65	-0.002613	±2.5	PASS
Band41	20MHz	QPSK	40140	100RB#0	NV	0	4.33	0.001701	±2.5	PASS
Band41	20MHz	QPSK	40140	100RB#0	NV	10	9.68	0.003804	±2.5	PASS
Band41	20MHz	QPSK	40140	100RB#0	NV	20	11.14	0.004377	±2.5	PASS
Band41	20MHz	QPSK	40590	100RB#0	NV	-30	-10.20	-0.003938	±2.5	PASS
Band41	20MHz	QPSK	40590	100RB#0	NV	-20	5.39	0.002081	±2.5	PASS
Band41	20MHz	QPSK	40590	100RB#0	NV	0	-11.46	-0.004425	±2.5	PASS
Band41	20MHz	QPSK	40590	100RB#0	NV	10	-6.75	-0.002606	±2.5	PASS
Band41	20MHz	QPSK	40590	100RB#0	NV	20	6.38	0.002463	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	NV	-30	-14.00	-0.005293	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	NV	-20	-9.54	-0.003607	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	NV	0	-15.13	-0.005720	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	NV	10	-16.81	-0.006355	±2.5	PASS
Band41	20MHz	QPSK	41140	100RB#0	NV	20	-15.86	-0.005996	±2.5	PASS
Band41	20MHz	16QAM	40140	100RB#0	NV	-30	10.74	0.004220	±2.5	PASS
Band41	20MHz	16QAM	40140	100RB#0	NV	-20	7.87	0.003092	±2.5	PASS
Band41	20MHz	16QAM	40140	100RB#0	NV	0	7.35	0.002888	±2.5	PASS
Band41	20MHz	16QAM	40140	100RB#0	NV	10	7.11	0.002794	±2.5	PASS
Band41	20MHz	16QAM	40140	100RB#0	NV	20	6.58	0.002585	±2.5	PASS
Band41	20MHz	16QAM	40590	100RB#0	NV	-30	-7.74	-0.002988	±2.5	PASS
Band41	20MHz	16QAM	40590	100RB#0	NV	-20	-8.87	-0.003425	±2.5	PASS
Band41	20MHz	16QAM	40590	100RB#0	NV	0	-6.52	-0.002517	±2.5	PASS
Band41	20MHz	16QAM	40590	100RB#0	NV	10	-10.66	-0.004116	±2.5	PASS
Band41	20MHz	16QAM	40590	100RB#0	NV	20	-7.42	-0.002865	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	NV	-30	-14.99	-0.005667	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band41	20MHz	16QAM	41140	100RB#0	NV	-20	-8.98	-0.003395	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	NV	0	-16.11	-0.006091	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	NV	10	-16.37	-0.006189	±2.5	PASS
Band41	20MHz	16QAM	41140	100RB#0	NV	20	-14.81	-0.005599	±2.5	PASS

---End---

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

