

# Appendix B

## NR Band N41



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.  
Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## CONTENT

Page

|          |                                                               |            |
|----------|---------------------------------------------------------------|------------|
| <b>1</b> | <b>EFFECTIVE (ISOTROPIC) RADIATED POWER OUTPUT DATA .....</b> | <b>3</b>   |
| <b>2</b> | <b>PEAK-TO-AVERAGE RATIO.....</b>                             | <b>27</b>  |
| 2.1      | TEST RESULTS .....                                            | 27         |
| 2.2      | TEST PLOTS.....                                               | 27         |
| <b>3</b> | <b>MODULATION CHARACTERISTICS.....</b>                        | <b>29</b>  |
| 3.1      | TEST PLOTS.....                                               | 29         |
| 3.1.1    | Test Band = N41 .....                                         | 29         |
| <b>4</b> | <b>OCCUPIED BANDWIDTH &amp; 26DB EMISSION BANDWIDTH.....</b>  | <b>32</b>  |
| 4.1      | TEST RESULTS .....                                            | 32         |
| 4.2      | TEST PLOTS.....                                               | 35         |
| <b>5</b> | <b>BAND EDGES COMPLIANCE.....</b>                             | <b>98</b>  |
| 5.1      | TEST PLOTS.....                                               | 98         |
| <b>6</b> | <b>SPURIOUS EMISSION AT ANTENNA TERMINAL.....</b>             | <b>155</b> |
| 6.1      | TEST PLOTS.....                                               | 155        |
| <b>7</b> | <b>FIELD STRENGTH OF SPURIOUS RADIATION .....</b>             | <b>159</b> |
| 7.1      | TEST BAND = N41.....                                          | 159        |
| 7.1.1    | Test Mode = TM1 .....                                         | 159        |
| <b>8</b> | <b>FREQUENCY STABILITY .....</b>                              | <b>161</b> |
| 8.1      | FREQUENCY ERROR VS. VOLTAGE .....                             | 161        |
| 8.2      | FREQUENCY ERROR VS. TEMPERATURE .....                         | 161        |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

SGS-CSTC Standards Technical Services Co., Ltd.  
Shenzhen Branch

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn  
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

## 1 Effective (Isotropic) Radiated Power Output Data

| NR Band | Bandwidth h | SCS   | Modulation | Channel l | RB Config       | Conducted Power(dBm ) | EIRP (dBm) | Limit (dBm) | Verdict |
|---------|-------------|-------|------------|-----------|-----------------|-----------------------|------------|-------------|---------|
| N41     | 10MHz       | 15KHz | TM1        | 500202    | Inner Full      | 22.22                 | 19.92      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM1        | 500202    | Inner 1RB Left  | 22.25                 | 19.95      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM1        | 500202    | Inner 1RB Right | 22.04                 | 19.74      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM1        | 518601    | Inner Full      | 22.69                 | 20.39      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM1        | 518601    | Inner 1RB Left  | 22.48                 | 20.18      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM1        | 518601    | Inner 1RB Right | 22.73                 | 20.43      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM1        | 537000    | Inner Full      | 22.56                 | 20.26      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM1        | 537000    | Inner 1RB Left  | 22.42                 | 20.12      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM1        | 537000    | Inner 1RB Right | 22.63                 | 20.33      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM2        | 500202    | Inner Full      | 22.25                 | 19.95      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM2        | 500202    | Inner 1RB Left  | 22.31                 | 20.01      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM2        | 500202    | Inner 1RB Right | 22.16                 | 19.86      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM2        | 518601    | Inner Full      | 22.69                 | 20.39      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM2        | 518601    | Inner 1RB Left  | 22.44                 | 20.14      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM2        | 518601    | Inner 1RB Right | 22.66                 | 20.36      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM2        | 537000    | Inner Full      | 22.66                 | 20.36      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM2        | 537000    | Inner 1RB Left  | 22.42                 | 20.12      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM2        | 537000    | Inner 1RB Right | 22.54                 | 20.24      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM3        | 500202    | Inner Full      | 21.34                 | 19.04      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM3        | 500202    | Inner 1RB Left  | 21.53                 | 19.23      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM3        | 500202    | Inner 1RB Right | 21.39                 | 19.09      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM3        | 518601    | Inner Full      | 21.69                 | 19.39      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM3        | 518601    | Inner 1RB Left  | 21.48                 | 19.18      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM3        | 518601    | Inner 1RB Right | 21.76                 | 19.46      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM3        | 537000    | Inner Full      | 21.64                 | 19.34      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM3        | 537000    | Inner 1RB Left  | 21.44                 | 19.14      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM3        | 537000    | Inner 1RB Right | 21.66                 | 19.36      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM4        | 500202    | Inner Full      | 21.34                 | 19.04      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM4        | 500202    | Inner 1RB Left  | 21.55                 | 19.25      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM4        | 500202    | Inner 1RB Right | 20.93                 | 18.63      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM4        | 518601    | Inner Full      | 20.23                 | 17.93      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM4        | 518601    | Inner 1RB Left  | 19.68                 | 17.38      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM4        | 518601    | Inner 1RB Right | 19.91                 | 17.61      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM4        | 537000    | Inner Full      | 20.2                  | 17.90      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM4        | 537000    | Inner 1RB Left  | 19.59                 | 17.29      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM4        | 537000    | Inner 1RB Right | 19.81                 | 17.51      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM5        | 500202    | Inner Full      | 19.71                 | 17.41      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM5        | 500202    | Inner 1RB Left  | 19.97                 | 17.67      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM5        | 500202    | Inner 1RB Right | 19.81                 | 17.51      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM5        | 518601    | Inner Full      | 18.36                 | 16.06      | 33.00       | PASS    |
| N41     | 10MHz       | 15KHz | TM5        | 518601    | Inner 1RB Left  | 18.49                 | 16.19      | 33.00       | PASS    |





|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 10MHz | 15KHz | TM5 | 518601 | Inner 1RB Right | 18.7  | 16.40 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM5 | 537000 | Inner Full      | 18.37 | 16.07 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM5 | 537000 | Inner 1RB Left  | 18.45 | 16.15 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM5 | 537000 | Inner 1RB Right | 18.65 | 16.35 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM6 | 500202 | Inner Full      | 22.27 | 19.97 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM6 | 500202 | Inner 1RB Left  | 22.24 | 19.94 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM6 | 500202 | Inner 1RB Right | 22.16 | 19.86 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM6 | 518601 | Inner Full      | 22.67 | 20.37 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM6 | 518601 | Inner 1RB Left  | 22.47 | 20.17 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM6 | 518601 | Inner 1RB Right | 22.68 | 20.38 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM6 | 537000 | Inner Full      | 22.65 | 20.35 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM6 | 537000 | Inner 1RB Left  | 22.44 | 20.14 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM6 | 537000 | Inner 1RB Right | 22.63 | 20.33 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM7 | 500202 | Inner Full      | 21.32 | 19.02 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM7 | 500202 | Inner 1RB Left  | 21.58 | 19.28 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM7 | 500202 | Inner 1RB Right | 21.45 | 19.15 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM7 | 518601 | Inner Full      | 21.67 | 19.37 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM7 | 518601 | Inner 1RB Left  | 21.55 | 19.25 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM7 | 518601 | Inner 1RB Right | 21.76 | 19.46 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM7 | 537000 | Inner Full      | 21.58 | 19.28 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM7 | 537000 | Inner 1RB Left  | 21.53 | 19.23 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM7 | 537000 | Inner 1RB Right | 21.67 | 19.37 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM8 | 500202 | Inner Full      | 21.23 | 18.93 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM8 | 500202 | Inner 1RB Left  | 21.62 | 19.32 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM8 | 500202 | Inner 1RB Right | 21.46 | 19.16 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM8 | 518601 | Inner Full      | 20.21 | 17.91 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM8 | 518601 | Inner 1RB Left  | 19.56 | 17.26 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM8 | 518601 | Inner 1RB Right | 19.79 | 17.49 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM8 | 537000 | Inner Full      | 20.11 | 17.81 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM8 | 537000 | Inner 1RB Left  | 19.66 | 17.36 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM8 | 537000 | Inner 1RB Right | 19.72 | 17.42 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM9 | 500202 | Inner Full      | 19.7  | 17.40 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM9 | 500202 | Inner 1RB Left  | 19.59 | 17.29 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM9 | 500202 | Inner 1RB Right | 19.72 | 17.42 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM9 | 518601 | Inner Full      | 18.36 | 16.06 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM9 | 518601 | Inner 1RB Left  | 18.49 | 16.19 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM9 | 518601 | Inner 1RB Right | 18.41 | 16.11 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM9 | 537000 | Inner Full      | 18.32 | 16.02 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM9 | 537000 | Inner 1RB Left  | 18.42 | 16.12 | 33.00 | PASS |
| N41 | 10MHz | 15KHz | TM9 | 537000 | Inner 1RB Right | 18.29 | 15.99 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM1 | 500700 | Inner Full      | 22.31 | 20.01 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM1 | 500700 | Inner 1RB Left  | 22.35 | 20.05 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM1 | 500700 | Inner 1RB Right | 22.21 | 19.91 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM1 | 518601 | Inner Full      | 22.83 | 20.53 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM1 | 518601 | Inner 1RB Left  | 22.52 | 20.22 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM1 | 518601 | Inner 1RB Right | 22.91 | 20.61 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM1 | 536499 | Inner Full      | 22.91 | 20.61 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM1 | 536499 | Inner 1RB Left  | 22.8  | 20.50 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)





|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 15MHz | 15KHz | TM1 | 536499 | Inner 1RB Right | 22.66 | 20.36 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM2 | 500700 | Inner Full      | 22.38 | 20.08 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM2 | 500700 | Inner 1RB Left  | 22.36 | 20.06 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM2 | 500700 | Inner 1RB Right | 22.21 | 19.91 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM2 | 518601 | Inner Full      | 22.8  | 20.50 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM2 | 518601 | Inner 1RB Left  | 22.44 | 20.14 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM2 | 518601 | Inner 1RB Right | 22.86 | 20.56 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM2 | 536499 | Inner Full      | 22.93 | 20.63 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM2 | 536499 | Inner 1RB Left  | 22.75 | 20.45 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM2 | 536499 | Inner 1RB Right | 22.6  | 20.30 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM3 | 500700 | Inner Full      | 21.37 | 19.07 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM3 | 500700 | Inner 1RB Left  | 21.74 | 19.44 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM3 | 500700 | Inner 1RB Right | 21.52 | 19.22 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM3 | 518601 | Inner Full      | 21.84 | 19.54 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM3 | 518601 | Inner 1RB Left  | 21.55 | 19.25 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM3 | 518601 | Inner 1RB Right | 21.87 | 19.57 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM3 | 536499 | Inner Full      | 21.93 | 19.63 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM3 | 536499 | Inner 1RB Left  | 21.79 | 19.49 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM3 | 536499 | Inner 1RB Right | 21.69 | 19.39 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM4 | 500700 | Inner Full      | 19.84 | 17.54 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM4 | 500700 | Inner 1RB Left  | 19.73 | 17.43 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM4 | 500700 | Inner 1RB Right | 19.44 | 17.14 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM4 | 518601 | Inner Full      | 20.29 | 17.99 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM4 | 518601 | Inner 1RB Left  | 19.63 | 17.33 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM4 | 518601 | Inner 1RB Right | 19.99 | 17.69 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM4 | 536499 | Inner Full      | 20.34 | 18.04 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM4 | 536499 | Inner 1RB Left  | 19.94 | 17.64 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM4 | 536499 | Inner 1RB Right | 19.92 | 17.62 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM5 | 500700 | Inner Full      | 18.05 | 15.75 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM5 | 500700 | Inner 1RB Left  | 17.97 | 15.67 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM5 | 500700 | Inner 1RB Right | 17.92 | 15.62 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM5 | 518601 | Inner Full      | 18.5  | 16.20 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM5 | 518601 | Inner 1RB Left  | 18.48 | 16.18 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM5 | 518601 | Inner 1RB Right | 18.57 | 16.27 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM5 | 536499 | Inner Full      | 18.6  | 16.30 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM5 | 536499 | Inner 1RB Left  | 18.71 | 16.41 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM5 | 536499 | Inner 1RB Right | 18.36 | 16.06 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM6 | 500700 | Inner Full      | 22.36 | 20.06 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM6 | 500700 | Inner 1RB Left  | 22.33 | 20.03 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM6 | 500700 | Inner 1RB Right | 22.2  | 19.90 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM6 | 518601 | Inner Full      | 22.83 | 20.53 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM6 | 518601 | Inner 1RB Left  | 22.44 | 20.14 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM6 | 518601 | Inner 1RB Right | 22.85 | 20.55 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM6 | 536499 | Inner Full      | 22.94 | 20.64 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM6 | 536499 | Inner 1RB Left  | 22.76 | 20.46 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM6 | 536499 | Inner 1RB Right | 22.61 | 20.31 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM7 | 500700 | Inner Full      | 21.33 | 19.03 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM7 | 500700 | Inner 1RB Left  | 21.67 | 19.37 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 15MHz | 15KHz | TM7 | 500700 | Inner 1RB Right | 21.52 | 19.22 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM7 | 518601 | Inner Full      | 21.81 | 19.51 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM7 | 518601 | Inner 1RB Left  | 21.55 | 19.25 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM7 | 518601 | Inner 1RB Right | 21.93 | 19.63 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM7 | 536499 | Inner Full      | 21.88 | 19.58 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM7 | 536499 | Inner 1RB Left  | 22.13 | 19.83 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM7 | 536499 | Inner 1RB Right | 22.04 | 19.74 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM8 | 500700 | Inner Full      | 19.83 | 17.53 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM8 | 500700 | Inner 1RB Left  | 19.56 | 17.26 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM8 | 500700 | Inner 1RB Right | 19.59 | 17.29 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM8 | 518601 | Inner Full      | 20.29 | 17.99 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM8 | 518601 | Inner 1RB Left  | 19.57 | 17.27 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM8 | 518601 | Inner 1RB Right | 20.03 | 17.73 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM8 | 536499 | Inner Full      | 20.41 | 18.11 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM8 | 536499 | Inner 1RB Left  | 19.98 | 17.68 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM8 | 536499 | Inner 1RB Right | 19.94 | 17.64 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM9 | 500700 | Inner Full      | 18.04 | 15.74 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM9 | 500700 | Inner 1RB Left  | 18.06 | 15.76 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM9 | 500700 | Inner 1RB Right | 17.83 | 15.53 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM9 | 518601 | Inner Full      | 18.42 | 16.12 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM9 | 518601 | Inner 1RB Left  | 18.19 | 15.89 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM9 | 518601 | Inner 1RB Right | 18.57 | 16.27 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM9 | 536499 | Inner Full      | 18.62 | 16.32 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM9 | 536499 | Inner 1RB Left  | 18.44 | 16.14 | 33.00 | PASS |
| N41 | 15MHz | 15KHz | TM9 | 536499 | Inner 1RB Right | 18.37 | 16.07 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM1 | 501201 | Inner Full      | 22.34 | 20.04 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM1 | 501201 | Inner 1RB Left  | 22.37 | 20.07 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM1 | 501201 | Inner 1RB Right | 22.42 | 20.12 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM1 | 518601 | Inner Full      | 22.82 | 20.52 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM1 | 518601 | Inner 1RB Left  | 22.45 | 20.15 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM1 | 518601 | Inner 1RB Right | 22.84 | 20.54 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM1 | 535998 | Inner Full      | 22.97 | 20.67 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM1 | 535998 | Inner 1RB Left  | 22.57 | 20.27 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM1 | 535998 | Inner 1RB Right | 22.65 | 20.35 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM2 | 501201 | Inner Full      | 22.34 | 20.04 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM2 | 501201 | Inner 1RB Left  | 22.28 | 19.98 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM2 | 501201 | Inner 1RB Right | 22.35 | 20.05 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM2 | 518601 | Inner Full      | 22.79 | 20.49 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM2 | 518601 | Inner 1RB Left  | 22.35 | 20.05 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM2 | 518601 | Inner 1RB Right | 22.8  | 20.50 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM2 | 535998 | Inner Full      | 22.91 | 20.61 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM2 | 535998 | Inner 1RB Left  | 22.49 | 20.19 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM2 | 535998 | Inner 1RB Right | 22.62 | 20.32 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM3 | 501201 | Inner Full      | 21.37 | 19.07 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM3 | 501201 | Inner 1RB Left  | 21.62 | 19.32 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM3 | 501201 | Inner 1RB Right | 21.32 | 19.02 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM3 | 518601 | Inner Full      | 21.79 | 19.49 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM3 | 518601 | Inner 1RB Left  | 21.7  | 19.40 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 20MHz | 15KHz | TM3 | 518601 | Inner 1RB Right | 21.89 | 19.59 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM3 | 535998 | Inner Full      | 21.85 | 19.55 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM3 | 535998 | Inner 1RB Left  | 21.6  | 19.30 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM3 | 535998 | Inner 1RB Right | 21.99 | 19.69 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM4 | 501201 | Inner Full      | 19.84 | 17.54 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM4 | 501201 | Inner 1RB Left  | 19.53 | 17.23 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM4 | 501201 | Inner 1RB Right | 19.73 | 17.43 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM4 | 518601 | Inner Full      | 20.27 | 17.97 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM4 | 518601 | Inner 1RB Left  | 19.47 | 17.17 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM4 | 518601 | Inner 1RB Right | 20.04 | 17.74 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM4 | 535998 | Inner Full      | 20.37 | 18.07 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM4 | 535998 | Inner 1RB Left  | 19.84 | 17.54 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM4 | 535998 | Inner 1RB Right | 19.84 | 17.54 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM5 | 501201 | Inner Full      | 17.95 | 15.65 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM5 | 501201 | Inner 1RB Left  | 17.94 | 15.64 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM5 | 501201 | Inner 1RB Right | 18.22 | 15.92 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM5 | 518601 | Inner Full      | 18.4  | 16.10 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM5 | 518601 | Inner 1RB Left  | 18.31 | 16.01 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM5 | 518601 | Inner 1RB Right | 18.83 | 16.53 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM5 | 535998 | Inner Full      | 18.54 | 16.24 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM5 | 535998 | Inner 1RB Left  | 18.58 | 16.28 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM5 | 535998 | Inner 1RB Right | 18.38 | 16.08 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM6 | 501201 | Inner Full      | 22.34 | 20.04 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM6 | 501201 | Inner 1RB Left  | 22.29 | 19.99 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM6 | 501201 | Inner 1RB Right | 22.36 | 20.06 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM6 | 518601 | Inner Full      | 22.84 | 20.54 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM6 | 518601 | Inner 1RB Left  | 22.31 | 20.01 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM6 | 518601 | Inner 1RB Right | 22.81 | 20.51 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM6 | 535998 | Inner Full      | 22.98 | 20.68 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM6 | 535998 | Inner 1RB Left  | 22.49 | 20.19 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM6 | 535998 | Inner 1RB Right | 22.54 | 20.24 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM7 | 501201 | Inner Full      | 21.39 | 19.09 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM7 | 501201 | Inner 1RB Left  | 21.7  | 19.40 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM7 | 501201 | Inner 1RB Right | 21.32 | 19.02 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM7 | 518601 | Inner Full      | 21.79 | 19.49 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM7 | 518601 | Inner 1RB Left  | 21.44 | 19.14 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM7 | 518601 | Inner 1RB Right | 22.21 | 19.91 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM7 | 535998 | Inner Full      | 21.9  | 19.60 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM7 | 535998 | Inner 1RB Left  | 21.93 | 19.63 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM7 | 535998 | Inner 1RB Right | 21.63 | 19.33 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM8 | 501201 | Inner Full      | 19.81 | 17.51 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM8 | 501201 | Inner 1RB Left  | 19.7  | 17.40 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM8 | 501201 | Inner 1RB Right | 19.71 | 17.41 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM8 | 518601 | Inner Full      | 20.29 | 17.99 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM8 | 518601 | Inner 1RB Left  | 19.61 | 17.31 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM8 | 518601 | Inner 1RB Right | 19.99 | 17.69 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM8 | 535998 | Inner Full      | 20.34 | 18.04 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM8 | 535998 | Inner 1RB Left  | 19.76 | 17.46 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)





|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 20MHz | 15KHz | TM8 | 535998 | Inner 1RB Right | 19.92 | 17.62 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM9 | 501201 | Inner Full      | 18.03 | 15.73 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM9 | 501201 | Inner 1RB Left  | 17.95 | 15.65 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM9 | 501201 | Inner 1RB Right | 17.97 | 15.67 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM9 | 518601 | Inner Full      | 18.39 | 16.09 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM9 | 518601 | Inner 1RB Left  | 18.31 | 16.01 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM9 | 518601 | Inner 1RB Right | 18.84 | 16.54 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM9 | 535998 | Inner Full      | 18.53 | 16.23 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM9 | 535998 | Inner 1RB Left  | 18.24 | 15.94 | 33.00 | PASS |
| N41 | 20MHz | 15KHz | TM9 | 535998 | Inner 1RB Right | 18.67 | 16.37 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM1 | 503202 | Inner Full      | 22.4  | 20.10 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM1 | 503202 | Inner 1RB Left  | 21.76 | 19.46 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM1 | 503202 | Inner 1RB Right | 21.58 | 19.28 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM1 | 518601 | Inner Full      | 22.71 | 20.41 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM1 | 518601 | Inner 1RB Left  | 21.68 | 19.38 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM1 | 518601 | Inner 1RB Right | 21.99 | 19.69 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM1 | 534000 | Inner Full      | 22.64 | 20.34 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM1 | 534000 | Inner 1RB Left  | 21.84 | 19.54 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM1 | 534000 | Inner 1RB Right | 22    | 19.70 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM2 | 503202 | Inner Full      | 22.38 | 20.08 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM2 | 503202 | Inner 1RB Left  | 21.77 | 19.47 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM2 | 503202 | Inner 1RB Right | 21.55 | 19.25 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM2 | 518601 | Inner Full      | 22.75 | 20.45 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM2 | 518601 | Inner 1RB Left  | 21.73 | 19.43 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM2 | 518601 | Inner 1RB Right | 21.94 | 19.64 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM2 | 534000 | Inner Full      | 22.59 | 20.29 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM2 | 534000 | Inner 1RB Left  | 21.89 | 19.59 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM2 | 534000 | Inner 1RB Right | 22    | 19.70 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM3 | 503202 | Inner Full      | 21.37 | 19.07 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM3 | 503202 | Inner 1RB Left  | 21.07 | 18.77 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM3 | 503202 | Inner 1RB Right | 20.84 | 18.54 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM3 | 518601 | Inner Full      | 21.73 | 19.43 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM3 | 518601 | Inner 1RB Left  | 21.11 | 18.81 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM3 | 518601 | Inner 1RB Right | 20.96 | 18.66 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM3 | 534000 | Inner Full      | 21.57 | 19.27 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM3 | 534000 | Inner 1RB Left  | 21.35 | 19.05 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM3 | 534000 | Inner 1RB Right | 21.03 | 18.73 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM4 | 503202 | Inner Full      | 19.86 | 17.56 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM4 | 503202 | Inner 1RB Left  | 18.92 | 16.62 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM4 | 503202 | Inner 1RB Right | 18.86 | 16.56 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM4 | 518601 | Inner Full      | 20.28 | 17.98 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM4 | 518601 | Inner 1RB Left  | 19.05 | 16.75 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM4 | 518601 | Inner 1RB Right | 19.27 | 16.97 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM4 | 534000 | Inner Full      | 20.08 | 17.78 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM4 | 534000 | Inner 1RB Left  | 19.24 | 16.94 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM4 | 534000 | Inner 1RB Right | 19.41 | 17.11 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM5 | 503202 | Inner Full      | 18.04 | 15.74 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM5 | 503202 | Inner 1RB Left  | 17.73 | 15.43 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)





|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 40MHz | 15KHz | TM5 | 503202 | Inner 1RB Right | 17.12 | 14.82 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM5 | 518601 | Inner Full      | 18.32 | 16.02 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM5 | 518601 | Inner 1RB Left  | 17.46 | 15.16 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM5 | 518601 | Inner 1RB Right | 17.63 | 15.33 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM5 | 534000 | Inner Full      | 18.24 | 15.94 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM5 | 534000 | Inner 1RB Left  | 17.68 | 15.38 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM5 | 534000 | Inner 1RB Right | 17.88 | 15.58 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM6 | 503202 | Inner Full      | 22.41 | 20.11 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM6 | 503202 | Inner 1RB Left  | 21.78 | 19.48 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM6 | 503202 | Inner 1RB Right | 21.53 | 19.23 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM6 | 518601 | Inner Full      | 22.75 | 20.45 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM6 | 518601 | Inner 1RB Left  | 21.7  | 19.40 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM6 | 518601 | Inner 1RB Right | 21.95 | 19.65 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM6 | 534000 | Inner Full      | 22.59 | 20.29 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM6 | 534000 | Inner 1RB Left  | 21.9  | 19.60 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM6 | 534000 | Inner 1RB Right | 21.99 | 19.69 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM7 | 503202 | Inner Full      | 21.4  | 19.10 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM7 | 503202 | Inner 1RB Left  | 21.07 | 18.77 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM7 | 503202 | Inner 1RB Right | 20.59 | 18.29 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM7 | 518601 | Inner Full      | 21.74 | 19.44 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM7 | 518601 | Inner 1RB Left  | 21.1  | 18.80 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM7 | 518601 | Inner 1RB Right | 20.96 | 18.66 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM7 | 534000 | Inner Full      | 21.58 | 19.28 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM7 | 534000 | Inner 1RB Left  | 20.92 | 18.62 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM7 | 534000 | Inner 1RB Right | 21.08 | 18.78 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM8 | 503202 | Inner Full      | 19.91 | 17.61 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM8 | 503202 | Inner 1RB Left  | 18.93 | 16.63 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM8 | 503202 | Inner 1RB Right | 18.86 | 16.56 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM8 | 518601 | Inner Full      | 20.18 | 17.88 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM8 | 518601 | Inner 1RB Left  | 18.89 | 16.59 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM8 | 518601 | Inner 1RB Right | 19.11 | 16.81 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM8 | 534000 | Inner Full      | 20.14 | 17.84 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM8 | 534000 | Inner 1RB Left  | 19.27 | 16.97 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM8 | 534000 | Inner 1RB Right | 19.24 | 16.94 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM9 | 503202 | Inner Full      | 17.97 | 15.67 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM9 | 503202 | Inner 1RB Left  | 17.71 | 15.41 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM9 | 503202 | Inner 1RB Right | 17.11 | 14.81 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM9 | 518601 | Inner Full      | 18.38 | 16.08 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM9 | 518601 | Inner 1RB Left  | 17.46 | 15.16 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM9 | 518601 | Inner 1RB Right | 17.7  | 15.40 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM9 | 534000 | Inner Full      | 18.24 | 15.94 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM9 | 534000 | Inner 1RB Left  | 17.59 | 15.29 | 33.00 | PASS |
| N41 | 40MHz | 15KHz | TM9 | 534000 | Inner 1RB Right | 17.83 | 15.53 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM1 | 504201 | Inner Full      | 22.34 | 20.04 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM1 | 504201 | Inner 1RB Left  | 22.11 | 19.81 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM1 | 504201 | Inner 1RB Right | 21.87 | 19.57 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM1 | 518601 | Inner Full      | 22.66 | 20.36 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM1 | 518601 | Inner 1RB Left  | 22.2  | 19.90 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 50MHz | 15KHz | TM1 | 518601 | Inner 1RB Right | 22.28 | 19.98 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM1 | 532998 | Inner Full      | 22.65 | 20.35 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM1 | 532998 | Inner 1RB Left  | 22.46 | 20.16 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM1 | 532998 | Inner 1RB Right | 22.42 | 20.12 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM2 | 504201 | Inner Full      | 22.33 | 20.03 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM2 | 504201 | Inner 1RB Left  | 22.14 | 19.84 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM2 | 504201 | Inner 1RB Right | 21.83 | 19.53 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM2 | 518601 | Inner Full      | 22.66 | 20.36 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM2 | 518601 | Inner 1RB Left  | 22.14 | 19.84 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM2 | 518601 | Inner 1RB Right | 22.17 | 19.87 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM2 | 532998 | Inner Full      | 22.69 | 20.39 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM2 | 532998 | Inner 1RB Left  | 22.38 | 20.08 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM2 | 532998 | Inner 1RB Right | 22.41 | 20.11 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM3 | 504201 | Inner Full      | 21.41 | 19.11 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM3 | 504201 | Inner 1RB Left  | 21.16 | 18.86 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM3 | 504201 | Inner 1RB Right | 21.14 | 18.84 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM3 | 518601 | Inner Full      | 21.6  | 19.30 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM3 | 518601 | Inner 1RB Left  | 21.24 | 18.94 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM3 | 518601 | Inner 1RB Right | 21.58 | 19.28 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM3 | 532998 | Inner Full      | 21.67 | 19.37 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM3 | 532998 | Inner 1RB Left  | 21.89 | 19.59 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM3 | 532998 | Inner 1RB Right | 21.84 | 19.54 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM4 | 504201 | Inner Full      | 19.91 | 17.61 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM4 | 504201 | Inner 1RB Left  | 19.27 | 16.97 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM4 | 504201 | Inner 1RB Right | 19.22 | 16.92 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM4 | 518601 | Inner Full      | 20.21 | 17.91 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM4 | 518601 | Inner 1RB Left  | 19.53 | 17.23 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM4 | 518601 | Inner 1RB Right | 19.56 | 17.26 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM4 | 532998 | Inner Full      | 20.16 | 17.86 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM4 | 532998 | Inner 1RB Left  | 19.74 | 17.44 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM4 | 532998 | Inner 1RB Right | 19.64 | 17.34 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM5 | 504201 | Inner Full      | 17.96 | 15.66 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM5 | 504201 | Inner 1RB Left  | 17.77 | 15.47 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM5 | 504201 | Inner 1RB Right | 17.51 | 15.21 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM5 | 518601 | Inner Full      | 18.31 | 16.01 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM5 | 518601 | Inner 1RB Left  | 17.85 | 15.55 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM5 | 518601 | Inner 1RB Right | 17.89 | 15.59 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM5 | 532998 | Inner Full      | 18.33 | 16.03 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM5 | 532998 | Inner 1RB Left  | 18.29 | 15.99 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM5 | 532998 | Inner 1RB Right | 18.3  | 16.00 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM6 | 504201 | Inner Full      | 22.38 | 20.08 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM6 | 504201 | Inner 1RB Left  | 22.11 | 19.81 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM6 | 504201 | Inner 1RB Right | 21.77 | 19.47 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM6 | 518601 | Inner Full      | 22.69 | 20.39 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM6 | 518601 | Inner 1RB Left  | 22.13 | 19.83 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM6 | 518601 | Inner 1RB Right | 22.17 | 19.87 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM6 | 532998 | Inner Full      | 22.67 | 20.37 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM6 | 532998 | Inner 1RB Left  | 22.45 | 20.15 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 50MHz | 15KHz | TM6 | 532998 | Inner 1RB Right | 22.45 | 20.15 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM7 | 504201 | Inner Full      | 21.37 | 19.07 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM7 | 504201 | Inner 1RB Left  | 21.46 | 19.16 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM7 | 504201 | Inner 1RB Right | 21.16 | 18.86 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM7 | 518601 | Inner Full      | 21.66 | 19.36 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM7 | 518601 | Inner 1RB Left  | 21.54 | 19.24 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM7 | 518601 | Inner 1RB Right | 21.3  | 19.00 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM7 | 532998 | Inner Full      | 21.7  | 19.40 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM7 | 532998 | Inner 1RB Left  | 21.47 | 19.17 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM7 | 532998 | Inner 1RB Right | 21.86 | 19.56 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM8 | 504201 | Inner Full      | 19.88 | 17.58 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM8 | 504201 | Inner 1RB Left  | 19.29 | 16.99 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM8 | 504201 | Inner 1RB Right | 19.03 | 16.73 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM8 | 518601 | Inner Full      | 20.22 | 17.92 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM8 | 518601 | Inner 1RB Left  | 19.37 | 17.07 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM8 | 518601 | Inner 1RB Right | 19.56 | 17.26 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM8 | 532998 | Inner Full      | 20.17 | 17.87 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM8 | 532998 | Inner 1RB Left  | 19.68 | 17.38 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM8 | 532998 | Inner 1RB Right | 19.82 | 17.52 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM9 | 504201 | Inner Full      | 17.97 | 15.67 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM9 | 504201 | Inner 1RB Left  | 17.76 | 15.46 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM9 | 504201 | Inner 1RB Right | 17.57 | 15.27 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM9 | 518601 | Inner Full      | 18.31 | 16.01 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM9 | 518601 | Inner 1RB Left  | 18.16 | 15.86 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM9 | 518601 | Inner 1RB Right | 17.92 | 15.62 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM9 | 532998 | Inner Full      | 18.27 | 15.97 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM9 | 532998 | Inner 1RB Left  | 18.28 | 15.98 | 33.00 | PASS |
| N41 | 50MHz | 15KHz | TM9 | 532998 | Inner 1RB Right | 18.3  | 16.00 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM1 | 500202 | Inner Full      | 22.34 | 20.04 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM1 | 500202 | Inner 1RB Left  | 22.27 | 19.97 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM1 | 500202 | Inner 1RB Right | 22.19 | 19.89 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM1 | 518598 | Inner Full      | 22.89 | 20.59 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM1 | 518598 | Inner 1RB Left  | 22.7  | 20.40 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM1 | 518598 | Inner 1RB Right | 22.81 | 20.51 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM1 | 537000 | Inner Full      | 22.99 | 20.69 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM1 | 537000 | Inner 1RB Left  | 22.82 | 20.52 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM1 | 537000 | Inner 1RB Right | 22.75 | 20.45 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM2 | 500202 | Inner Full      | 22.35 | 20.05 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM2 | 500202 | Inner 1RB Left  | 22.48 | 20.18 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM2 | 500202 | Inner 1RB Right | 22.28 | 19.98 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM2 | 518598 | Inner Full      | 22.89 | 20.59 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM2 | 518598 | Inner 1RB Left  | 22.72 | 20.42 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM2 | 518598 | Inner 1RB Right | 22.85 | 20.55 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM2 | 537000 | Inner Full      | 23.03 | 20.73 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM2 | 537000 | Inner 1RB Left  | 22.76 | 20.46 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM2 | 537000 | Inner 1RB Right | 22.67 | 20.37 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM3 | 500202 | Inner Full      | 21.41 | 19.11 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM3 | 500202 | Inner 1RB Left  | 21.67 | 19.37 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)





|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 10MHz | 30KHz | TM3 | 500202 | Inner 1RB Right | 21.57 | 19.27 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM3 | 518598 | Inner Full      | 21.9  | 19.60 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM3 | 518598 | Inner 1RB Left  | 21.99 | 19.69 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM3 | 518598 | Inner 1RB Right | 21.85 | 19.55 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM3 | 537000 | Inner Full      | 22.05 | 19.75 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM3 | 537000 | Inner 1RB Left  | 22.09 | 19.79 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM3 | 537000 | Inner 1RB Right | 21.93 | 19.63 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM4 | 500202 | Inner Full      | 19.86 | 17.56 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM4 | 500202 | Inner 1RB Left  | 19.54 | 17.24 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM4 | 500202 | Inner 1RB Right | 19.41 | 17.11 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM4 | 518598 | Inner Full      | 20.43 | 18.13 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM4 | 518598 | Inner 1RB Left  | 19.86 | 17.56 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM4 | 518598 | Inner 1RB Right | 20.03 | 17.73 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM4 | 537000 | Inner Full      | 20.39 | 18.09 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM4 | 537000 | Inner 1RB Left  | 20.01 | 17.71 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM4 | 537000 | Inner 1RB Right | 19.99 | 17.69 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM5 | 500202 | Inner Full      | 18.14 | 15.84 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM5 | 500202 | Inner 1RB Left  | 18.32 | 16.02 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM5 | 500202 | Inner 1RB Right | 18.21 | 15.91 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM5 | 518598 | Inner Full      | 18.63 | 16.33 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM5 | 518598 | Inner 1RB Left  | 18.67 | 16.37 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM5 | 518598 | Inner 1RB Right | 18.85 | 16.55 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM5 | 537000 | Inner Full      | 18.75 | 16.45 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM5 | 537000 | Inner 1RB Left  | 18.48 | 16.18 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM5 | 537000 | Inner 1RB Right | 18.65 | 16.35 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM6 | 500202 | Inner Full      | 22.38 | 20.08 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM6 | 500202 | Inner 1RB Left  | 22.47 | 20.17 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM6 | 500202 | Inner 1RB Right | 22.37 | 20.07 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM6 | 518598 | Inner Full      | 22.9  | 20.60 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM6 | 518598 | Inner 1RB Left  | 22.72 | 20.42 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM6 | 518598 | Inner 1RB Right | 22.93 | 20.63 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM6 | 537000 | Inner Full      | 22.97 | 20.67 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM6 | 537000 | Inner 1RB Left  | 22.78 | 20.48 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM6 | 537000 | Inner 1RB Right | 22.65 | 20.35 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM7 | 500202 | Inner Full      | 21.4  | 19.10 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM7 | 500202 | Inner 1RB Left  | 21.75 | 19.45 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM7 | 500202 | Inner 1RB Right | 21.57 | 19.27 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM7 | 518598 | Inner Full      | 22.03 | 19.73 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM7 | 518598 | Inner 1RB Left  | 21.96 | 19.66 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM7 | 518598 | Inner 1RB Right | 21.89 | 19.59 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM7 | 537000 | Inner Full      | 21.92 | 19.62 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM7 | 537000 | Inner 1RB Left  | 21.81 | 19.51 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM7 | 537000 | Inner 1RB Right | 21.73 | 19.43 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM8 | 500202 | Inner Full      | 19.78 | 17.48 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM8 | 500202 | Inner 1RB Left  | 19.56 | 17.26 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM8 | 500202 | Inner 1RB Right | 19.42 | 17.12 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM8 | 518598 | Inner Full      | 20.33 | 18.03 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM8 | 518598 | Inner 1RB Left  | 19.82 | 17.52 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 10MHz | 30KHz | TM8 | 518598 | Inner 1RB Right | 20.06 | 17.76 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM8 | 537000 | Inner Full      | 20.4  | 18.10 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM8 | 537000 | Inner 1RB Left  | 20    | 17.70 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM8 | 537000 | Inner 1RB Right | 19.95 | 17.65 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM9 | 500202 | Inner Full      | 18.1  | 15.80 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM9 | 500202 | Inner 1RB Left  | 18.32 | 16.02 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM9 | 500202 | Inner 1RB Right | 17.89 | 15.59 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM9 | 518598 | Inner Full      | 18.52 | 16.22 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM9 | 518598 | Inner 1RB Left  | 18.65 | 16.35 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM9 | 518598 | Inner 1RB Right | 18.51 | 16.21 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM9 | 537000 | Inner Full      | 18.6  | 16.30 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM9 | 537000 | Inner 1RB Left  | 18.8  | 16.50 | 33.00 | PASS |
| N41 | 10MHz | 30KHz | TM9 | 537000 | Inner 1RB Right | 18.74 | 16.44 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM1 | 500700 | Inner Full      | 22.36 | 20.06 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM1 | 500700 | Inner 1RB Left  | 22.35 | 20.05 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM1 | 500700 | Inner 1RB Right | 22.19 | 19.89 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM1 | 518598 | Inner Full      | 22.79 | 20.49 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM1 | 518598 | Inner 1RB Left  | 22.51 | 20.21 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM1 | 518598 | Inner 1RB Right | 22.86 | 20.56 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM1 | 536496 | Inner Full      | 22.91 | 20.61 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM1 | 536496 | Inner 1RB Left  | 22.87 | 20.57 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM1 | 536496 | Inner 1RB Right | 22.68 | 20.38 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM2 | 500700 | Inner Full      | 22.28 | 19.98 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM2 | 500700 | Inner 1RB Left  | 22.4  | 20.10 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM2 | 500700 | Inner 1RB Right | 22.38 | 20.08 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM2 | 518598 | Inner Full      | 22.77 | 20.47 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM2 | 518598 | Inner 1RB Left  | 22.53 | 20.23 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM2 | 518598 | Inner 1RB Right | 22.87 | 20.57 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM2 | 536496 | Inner Full      | 22.96 | 20.66 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM2 | 536496 | Inner 1RB Left  | 22.77 | 20.47 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM2 | 536496 | Inner 1RB Right | 22.72 | 20.42 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM3 | 500700 | Inner Full      | 21.37 | 19.07 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM3 | 500700 | Inner 1RB Left  | 21.7  | 19.40 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM3 | 500700 | Inner 1RB Right | 21.58 | 19.28 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM3 | 518598 | Inner Full      | 21.94 | 19.64 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM3 | 518598 | Inner 1RB Left  | 21.81 | 19.51 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM3 | 518598 | Inner 1RB Right | 22.12 | 19.82 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM3 | 536496 | Inner Full      | 21.95 | 19.65 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM3 | 536496 | Inner 1RB Left  | 21.7  | 19.40 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM3 | 536496 | Inner 1RB Right | 21.65 | 19.35 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM4 | 500700 | Inner Full      | 19.85 | 17.55 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM4 | 500700 | Inner 1RB Left  | 19.71 | 17.41 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM4 | 500700 | Inner 1RB Right | 19.56 | 17.26 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM4 | 518598 | Inner Full      | 20.33 | 18.03 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM4 | 518598 | Inner 1RB Left  | 19.72 | 17.42 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM4 | 518598 | Inner 1RB Right | 20.09 | 17.79 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM4 | 536496 | Inner Full      | 20.31 | 18.01 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM4 | 536496 | Inner 1RB Left  | 20.09 | 17.79 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 15MHz | 30KHz | TM4 | 536496 | Inner 1RB Right | 19.93 | 17.63 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM5 | 500700 | Inner Full      | 17.98 | 15.68 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM5 | 500700 | Inner 1RB Left  | 17.94 | 15.64 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM5 | 500700 | Inner 1RB Right | 17.89 | 15.59 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM5 | 518598 | Inner Full      | 18.44 | 16.14 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM5 | 518598 | Inner 1RB Left  | 18.19 | 15.89 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM5 | 518598 | Inner 1RB Right | 18.56 | 16.26 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM5 | 536496 | Inner Full      | 18.59 | 16.29 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM5 | 536496 | Inner 1RB Left  | 18.52 | 16.22 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM5 | 536496 | Inner 1RB Right | 18.41 | 16.11 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM6 | 500700 | Inner Full      | 22.33 | 20.03 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM6 | 500700 | Inner 1RB Left  | 22.38 | 20.08 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM6 | 500700 | Inner 1RB Right | 22.3  | 20.00 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM6 | 518598 | Inner Full      | 22.75 | 20.45 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM6 | 518598 | Inner 1RB Left  | 22.6  | 20.30 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM6 | 518598 | Inner 1RB Right | 22.86 | 20.56 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM6 | 536496 | Inner Full      | 22.88 | 20.58 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM6 | 536496 | Inner 1RB Left  | 22.82 | 20.52 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM6 | 536496 | Inner 1RB Right | 22.77 | 20.47 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM7 | 500700 | Inner Full      | 21.28 | 18.98 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM7 | 500700 | Inner 1RB Left  | 21.71 | 19.41 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM7 | 500700 | Inner 1RB Right | 21.19 | 18.89 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM7 | 518598 | Inner Full      | 21.75 | 19.45 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM7 | 518598 | Inner 1RB Left  | 21.57 | 19.27 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM7 | 518598 | Inner 1RB Right | 21.87 | 19.57 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM7 | 536496 | Inner Full      | 21.94 | 19.64 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM7 | 536496 | Inner 1RB Left  | 21.7  | 19.40 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM7 | 536496 | Inner 1RB Right | 21.66 | 19.36 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM8 | 500700 | Inner Full      | 19.77 | 17.47 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM8 | 500700 | Inner 1RB Left  | 19.71 | 17.41 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM8 | 500700 | Inner 1RB Right | 19.45 | 17.15 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM8 | 518598 | Inner Full      | 20.29 | 17.99 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM8 | 518598 | Inner 1RB Left  | 19.73 | 17.43 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM8 | 518598 | Inner 1RB Right | 20.07 | 17.77 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM8 | 536496 | Inner Full      | 20.33 | 18.03 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM8 | 536496 | Inner 1RB Left  | 20.08 | 17.78 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM8 | 536496 | Inner 1RB Right | 20.03 | 17.73 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM9 | 500700 | Inner Full      | 17.98 | 15.68 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM9 | 500700 | Inner 1RB Left  | 18.27 | 15.97 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM9 | 500700 | Inner 1RB Right | 17.85 | 15.55 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM9 | 518598 | Inner Full      | 18.47 | 16.17 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM9 | 518598 | Inner 1RB Left  | 18.19 | 15.89 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM9 | 518598 | Inner 1RB Right | 18.53 | 16.23 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM9 | 536496 | Inner Full      | 18.58 | 16.28 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM9 | 536496 | Inner 1RB Left  | 18.51 | 16.21 | 33.00 | PASS |
| N41 | 15MHz | 30KHz | TM9 | 536496 | Inner 1RB Right | 18.46 | 16.16 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM1 | 501204 | Inner Full      | 22.33 | 20.03 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM1 | 501204 | Inner 1RB Left  | 22.33 | 20.03 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)





|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 20MHz | 30KHz | TM1 | 501204 | Inner 1RB Right | 22.36 | 20.06 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM1 | 518598 | Inner Full      | 22.75 | 20.45 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM1 | 518598 | Inner 1RB Left  | 22.51 | 20.21 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM1 | 518598 | Inner 1RB Right | 22.89 | 20.59 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM1 | 535998 | Inner Full      | 22.93 | 20.63 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM1 | 535998 | Inner 1RB Left  | 22.65 | 20.35 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM1 | 535998 | Inner 1RB Right | 22.7  | 20.40 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM2 | 501204 | Inner Full      | 22.35 | 20.05 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM2 | 501204 | Inner 1RB Left  | 22.41 | 20.11 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM2 | 501204 | Inner 1RB Right | 22.33 | 20.03 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM2 | 518598 | Inner Full      | 22.8  | 20.50 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM2 | 518598 | Inner 1RB Left  | 22.48 | 20.18 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM2 | 518598 | Inner 1RB Right | 22.85 | 20.55 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM2 | 535998 | Inner Full      | 22.91 | 20.61 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM2 | 535998 | Inner 1RB Left  | 22.62 | 20.32 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM2 | 535998 | Inner 1RB Right | 22.67 | 20.37 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM3 | 501204 | Inner Full      | 21.37 | 19.07 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM3 | 501204 | Inner 1RB Left  | 21.3  | 19.00 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM3 | 501204 | Inner 1RB Right | 21.62 | 19.32 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM3 | 518598 | Inner Full      | 21.83 | 19.53 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM3 | 518598 | Inner 1RB Left  | 21.55 | 19.25 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM3 | 518598 | Inner 1RB Right | 21.95 | 19.65 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM3 | 535998 | Inner Full      | 21.87 | 19.57 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM3 | 535998 | Inner 1RB Left  | 21.95 | 19.65 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM3 | 535998 | Inner 1RB Right | 21.96 | 19.66 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM4 | 501204 | Inner Full      | 19.85 | 17.55 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM4 | 501204 | Inner 1RB Left  | 19.69 | 17.39 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM4 | 501204 | Inner 1RB Right | 19.58 | 17.28 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM4 | 518598 | Inner Full      | 20.31 | 18.01 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM4 | 518598 | Inner 1RB Left  | 19.68 | 17.38 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM4 | 518598 | Inner 1RB Right | 19.93 | 17.63 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM4 | 535998 | Inner Full      | 20.44 | 18.14 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM4 | 535998 | Inner 1RB Left  | 19.9  | 17.60 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM4 | 535998 | Inner 1RB Right | 20.01 | 17.71 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM5 | 501204 | Inner Full      | 17.92 | 15.62 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM5 | 501204 | Inner 1RB Left  | 17.9  | 15.60 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM5 | 501204 | Inner 1RB Right | 18.3  | 16.00 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM5 | 518598 | Inner Full      | 18.4  | 16.10 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM5 | 518598 | Inner 1RB Left  | 17.99 | 15.69 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM5 | 518598 | Inner 1RB Right | 18.43 | 16.13 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM5 | 535998 | Inner Full      | 18.47 | 16.17 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM5 | 535998 | Inner 1RB Left  | 18.63 | 16.33 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM5 | 535998 | Inner 1RB Right | 18.36 | 16.06 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM6 | 501204 | Inner Full      | 22.31 | 20.01 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM6 | 501204 | Inner 1RB Left  | 22.38 | 20.08 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM6 | 501204 | Inner 1RB Right | 22.41 | 20.11 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM6 | 518598 | Inner Full      | 22.87 | 20.57 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM6 | 518598 | Inner 1RB Left  | 22.42 | 20.12 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 20MHz | 30KHz | TM6 | 518598 | Inner 1RB Right | 22.84 | 20.54 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM6 | 535998 | Inner Full      | 22.93 | 20.63 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM6 | 535998 | Inner 1RB Left  | 22.59 | 20.29 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM6 | 535998 | Inner 1RB Right | 22.65 | 20.35 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM7 | 501204 | Inner Full      | 21.43 | 19.13 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM7 | 501204 | Inner 1RB Left  | 21.64 | 19.34 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM7 | 501204 | Inner 1RB Right | 21.3  | 19.00 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM7 | 518598 | Inner Full      | 21.81 | 19.51 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM7 | 518598 | Inner 1RB Left  | 21.75 | 19.45 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM7 | 518598 | Inner 1RB Right | 21.94 | 19.64 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM7 | 535998 | Inner Full      | 21.85 | 19.55 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM7 | 535998 | Inner 1RB Left  | 21.65 | 19.35 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM7 | 535998 | Inner 1RB Right | 21.71 | 19.41 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM8 | 501204 | Inner Full      | 19.83 | 17.53 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM8 | 501204 | Inner 1RB Left  | 19.66 | 17.36 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM8 | 501204 | Inner 1RB Right | 19.54 | 17.24 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM8 | 518598 | Inner Full      | 20.27 | 17.97 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM8 | 518598 | Inner 1RB Left  | 19.64 | 17.34 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM8 | 518598 | Inner 1RB Right | 20.07 | 17.77 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM8 | 535998 | Inner Full      | 20.43 | 18.13 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM8 | 535998 | Inner 1RB Left  | 19.84 | 17.54 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM8 | 535998 | Inner 1RB Right | 19.96 | 17.66 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM9 | 501204 | Inner Full      | 18.01 | 15.71 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM9 | 501204 | Inner 1RB Left  | 17.96 | 15.66 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM9 | 501204 | Inner 1RB Right | 18.3  | 16.00 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM9 | 518598 | Inner Full      | 18.39 | 16.09 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM9 | 518598 | Inner 1RB Left  | 18.4  | 16.10 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM9 | 518598 | Inner 1RB Right | 18.86 | 16.56 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM9 | 535998 | Inner Full      | 18.5  | 16.20 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM9 | 535998 | Inner 1RB Left  | 18.63 | 16.33 | 33.00 | PASS |
| N41 | 20MHz | 30KHz | TM9 | 535998 | Inner 1RB Right | 18.7  | 16.40 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM1 | 503202 | Inner Full      | 22.33 | 20.03 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM1 | 503202 | Inner 1RB Left  | 21.98 | 19.68 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM1 | 503202 | Inner 1RB Right | 21.84 | 19.54 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM1 | 518598 | Inner Full      | 22.68 | 20.38 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM1 | 518598 | Inner 1RB Left  | 21.79 | 19.49 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM1 | 518598 | Inner 1RB Right | 22    | 19.70 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM1 | 534000 | Inner Full      | 22.6  | 20.30 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM1 | 534000 | Inner 1RB Left  | 21.94 | 19.64 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM1 | 534000 | Inner 1RB Right | 22.17 | 19.87 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM2 | 503202 | Inner Full      | 22.36 | 20.06 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM2 | 503202 | Inner 1RB Left  | 21.85 | 19.55 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM2 | 503202 | Inner 1RB Right | 21.61 | 19.31 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM2 | 518598 | Inner Full      | 22.73 | 20.43 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM2 | 518598 | Inner 1RB Left  | 21.8  | 19.50 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM2 | 518598 | Inner 1RB Right | 21.98 | 19.68 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM2 | 534000 | Inner Full      | 22.62 | 20.32 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM2 | 534000 | Inner 1RB Left  | 21.84 | 19.54 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 40MHz | 30KHz | TM2 | 534000 | Inner 1RB Right | 22.02 | 19.72 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM3 | 503202 | Inner Full      | 21.32 | 19.02 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM3 | 503202 | Inner 1RB Left  | 20.86 | 18.56 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM3 | 503202 | Inner 1RB Right | 20.6  | 18.30 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM3 | 518598 | Inner Full      | 21.68 | 19.38 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM3 | 518598 | Inner 1RB Left  | 21.04 | 18.74 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM3 | 518598 | Inner 1RB Right | 21.31 | 19.01 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM3 | 534000 | Inner Full      | 21.59 | 19.29 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM3 | 534000 | Inner 1RB Left  | 21.29 | 18.99 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM3 | 534000 | Inner 1RB Right | 21.45 | 19.15 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM4 | 503202 | Inner Full      | 19.87 | 17.57 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM4 | 503202 | Inner 1RB Left  | 19.12 | 16.82 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM4 | 503202 | Inner 1RB Right | 18.92 | 16.62 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM4 | 518598 | Inner Full      | 20.19 | 17.89 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM4 | 518598 | Inner 1RB Left  | 18.98 | 16.68 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM4 | 518598 | Inner 1RB Right | 19.18 | 16.88 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM4 | 534000 | Inner Full      | 20.09 | 17.79 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM4 | 534000 | Inner 1RB Left  | 19.18 | 16.88 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM4 | 534000 | Inner 1RB Right | 19.39 | 17.09 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM5 | 503202 | Inner Full      | 17.97 | 15.67 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM5 | 503202 | Inner 1RB Left  | 17.45 | 15.15 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM5 | 503202 | Inner 1RB Right | 17.25 | 14.95 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM5 | 518598 | Inner Full      | 18.3  | 16.00 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM5 | 518598 | Inner 1RB Left  | 17.46 | 15.16 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM5 | 518598 | Inner 1RB Right | 17.68 | 15.38 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM5 | 534000 | Inner Full      | 18.2  | 15.90 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM5 | 534000 | Inner 1RB Left  | 18.02 | 15.72 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM5 | 534000 | Inner 1RB Right | 18.17 | 15.87 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM6 | 503202 | Inner Full      | 22.37 | 20.07 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM6 | 503202 | Inner 1RB Left  | 21.84 | 19.54 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM6 | 503202 | Inner 1RB Right | 21.64 | 19.34 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM6 | 518598 | Inner Full      | 22.72 | 20.42 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM6 | 518598 | Inner 1RB Left  | 21.74 | 19.44 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM6 | 518598 | Inner 1RB Right | 22.04 | 19.74 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM6 | 534000 | Inner Full      | 22.6  | 20.30 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM6 | 534000 | Inner 1RB Left  | 21.86 | 19.56 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM6 | 534000 | Inner 1RB Right | 22    | 19.70 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM7 | 503202 | Inner Full      | 21.34 | 19.04 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM7 | 503202 | Inner 1RB Left  | 20.88 | 18.58 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM7 | 503202 | Inner 1RB Right | 20.6  | 18.30 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM7 | 518598 | Inner Full      | 21.66 | 19.36 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM7 | 518598 | Inner 1RB Left  | 21.05 | 18.75 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM7 | 518598 | Inner 1RB Right | 21.23 | 18.93 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM7 | 534000 | Inner Full      | 21.54 | 19.24 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM7 | 534000 | Inner 1RB Left  | 20.98 | 18.68 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM7 | 534000 | Inner 1RB Right | 21.12 | 18.82 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM8 | 503202 | Inner Full      | 19.84 | 17.54 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM8 | 503202 | Inner 1RB Left  | 19.14 | 16.84 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)





|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 40MHz | 30KHz | TM8 | 503202 | Inner 1RB Right | 18.93 | 16.63 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM8 | 518598 | Inner Full      | 20.19 | 17.89 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM8 | 518598 | Inner 1RB Left  | 19.04 | 16.74 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM8 | 518598 | Inner 1RB Right | 19.25 | 16.95 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM8 | 534000 | Inner Full      | 19.96 | 17.66 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM8 | 534000 | Inner 1RB Left  | 19.17 | 16.87 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM8 | 534000 | Inner 1RB Right | 19.29 | 16.99 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM9 | 503202 | Inner Full      | 17.97 | 15.67 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM9 | 503202 | Inner 1RB Left  | 17.38 | 15.08 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM9 | 503202 | Inner 1RB Right | 17.18 | 14.88 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM9 | 518598 | Inner Full      | 18.34 | 16.04 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM9 | 518598 | Inner 1RB Left  | 17.44 | 15.14 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM9 | 518598 | Inner 1RB Right | 17.65 | 15.35 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM9 | 534000 | Inner Full      | 18.2  | 15.90 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM9 | 534000 | Inner 1RB Left  | 17.71 | 15.41 | 33.00 | PASS |
| N41 | 40MHz | 30KHz | TM9 | 534000 | Inner 1RB Right | 17.82 | 15.52 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM1 | 504204 | Inner Full      | 22.44 | 20.14 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM1 | 504204 | Inner 1RB Left  | 22.26 | 19.96 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM1 | 504204 | Inner 1RB Right | 21.98 | 19.68 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM1 | 518598 | Inner Full      | 22.7  | 20.40 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM1 | 518598 | Inner 1RB Left  | 22.11 | 19.81 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM1 | 518598 | Inner 1RB Right | 22.12 | 19.82 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM1 | 532998 | Inner Full      | 22.61 | 20.31 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM1 | 532998 | Inner 1RB Left  | 22.34 | 20.04 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM1 | 532998 | Inner 1RB Right | 22.37 | 20.07 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM2 | 504204 | Inner Full      | 22.38 | 20.08 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM2 | 504204 | Inner 1RB Left  | 22.08 | 19.78 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM2 | 504204 | Inner 1RB Right | 21.86 | 19.56 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM2 | 518598 | Inner Full      | 22.7  | 20.40 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM2 | 518598 | Inner 1RB Left  | 22.1  | 19.80 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM2 | 518598 | Inner 1RB Right | 22.19 | 19.89 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM2 | 532998 | Inner Full      | 22.64 | 20.34 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM2 | 532998 | Inner 1RB Left  | 22.56 | 20.26 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM2 | 532998 | Inner 1RB Right | 22.56 | 20.26 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM3 | 504204 | Inner Full      | 21.37 | 19.07 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM3 | 504204 | Inner 1RB Left  | 21.09 | 18.79 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM3 | 504204 | Inner 1RB Right | 20.82 | 18.52 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM3 | 518598 | Inner Full      | 21.66 | 19.36 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM3 | 518598 | Inner 1RB Left  | 21.05 | 18.75 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM3 | 518598 | Inner 1RB Right | 21.1  | 18.80 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM3 | 532998 | Inner Full      | 21.69 | 19.39 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM3 | 532998 | Inner 1RB Left  | 21.36 | 19.06 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM3 | 532998 | Inner 1RB Right | 21.39 | 19.09 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM4 | 504204 | Inner Full      | 19.81 | 17.51 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM4 | 504204 | Inner 1RB Left  | 19.32 | 17.02 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM4 | 504204 | Inner 1RB Right | 19.2  | 16.90 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM4 | 518598 | Inner Full      | 20.18 | 17.88 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM4 | 518598 | Inner 1RB Left  | 19.34 | 17.04 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 50MHz | 30KHz | TM4 | 518598 | Inner 1RB Right | 19.36 | 17.06 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM4 | 532998 | Inner Full      | 20.18 | 17.88 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM4 | 532998 | Inner 1RB Left  | 19.66 | 17.36 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM4 | 532998 | Inner 1RB Right | 19.67 | 17.37 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM5 | 504204 | Inner Full      | 18    | 15.70 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM5 | 504204 | Inner 1RB Left  | 17.65 | 15.35 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM5 | 504204 | Inner 1RB Right | 17.51 | 15.21 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM5 | 518598 | Inner Full      | 18.34 | 16.04 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM5 | 518598 | Inner 1RB Left  | 18.18 | 15.88 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM5 | 518598 | Inner 1RB Right | 17.94 | 15.64 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM5 | 532998 | Inner Full      | 18.37 | 16.07 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM5 | 532998 | Inner 1RB Left  | 18.27 | 15.97 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM5 | 532998 | Inner 1RB Right | 18.27 | 15.97 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM6 | 504204 | Inner Full      | 22.4  | 20.10 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM6 | 504204 | Inner 1RB Left  | 22.1  | 19.80 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM6 | 504204 | Inner 1RB Right | 21.79 | 19.49 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM6 | 518598 | Inner Full      | 22.65 | 20.35 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM6 | 518598 | Inner 1RB Left  | 22.09 | 19.79 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM6 | 518598 | Inner 1RB Right | 22.24 | 19.94 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM6 | 532998 | Inner Full      | 22.7  | 20.40 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM6 | 532998 | Inner 1RB Left  | 22.56 | 20.26 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM6 | 532998 | Inner 1RB Right | 22.49 | 20.19 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM7 | 504204 | Inner Full      | 21.37 | 19.07 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM7 | 504204 | Inner 1RB Left  | 21.02 | 18.72 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM7 | 504204 | Inner 1RB Right | 20.91 | 18.61 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM7 | 518598 | Inner Full      | 21.72 | 19.42 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM7 | 518598 | Inner 1RB Left  | 21.04 | 18.74 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM7 | 518598 | Inner 1RB Right | 21.12 | 18.82 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM7 | 532998 | Inner Full      | 21.66 | 19.36 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM7 | 532998 | Inner 1RB Left  | 21.34 | 19.04 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM7 | 532998 | Inner 1RB Right | 21.44 | 19.14 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM8 | 504204 | Inner Full      | 19.87 | 17.57 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM8 | 504204 | Inner 1RB Left  | 19.37 | 17.07 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM8 | 504204 | Inner 1RB Right | 19.19 | 16.89 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM8 | 518598 | Inner Full      | 20.18 | 17.88 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM8 | 518598 | Inner 1RB Left  | 19.28 | 16.98 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM8 | 518598 | Inner 1RB Right | 19.36 | 17.06 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM8 | 532998 | Inner Full      | 20.2  | 17.90 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM8 | 532998 | Inner 1RB Left  | 19.65 | 17.35 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM8 | 532998 | Inner 1RB Right | 19.68 | 17.38 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM9 | 504204 | Inner Full      | 18.02 | 15.72 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM9 | 504204 | Inner 1RB Left  | 17.71 | 15.41 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM9 | 504204 | Inner 1RB Right | 17.52 | 15.22 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM9 | 518598 | Inner Full      | 18.31 | 16.01 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM9 | 518598 | Inner 1RB Left  | 17.83 | 15.53 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM9 | 518598 | Inner 1RB Right | 17.87 | 15.57 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM9 | 532998 | Inner Full      | 18.29 | 15.99 | 33.00 | PASS |
| N41 | 50MHz | 30KHz | TM9 | 532998 | Inner 1RB Left  | 18.21 | 15.91 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 50MHz | 30KHz | TM9 | 532998 | Inner 1RB Right | 18.27 | 15.97 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM1 | 505200 | Inner Full      | 22.26 | 19.96 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM1 | 505200 | Inner 1RB Left  | 21.84 | 19.54 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM1 | 505200 | Inner 1RB Right | 21.97 | 19.67 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM1 | 518598 | Inner Full      | 22.68 | 20.38 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM1 | 518598 | Inner 1RB Left  | 22.12 | 19.82 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM1 | 518598 | Inner 1RB Right | 21.86 | 19.56 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM1 | 531996 | Inner Full      | 22.58 | 20.28 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM1 | 531996 | Inner 1RB Left  | 22.3  | 20.00 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM1 | 531996 | Inner 1RB Right | 22.29 | 19.99 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM2 | 505200 | Inner Full      | 22.26 | 19.96 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM2 | 505200 | Inner 1RB Left  | 21.95 | 19.65 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM2 | 505200 | Inner 1RB Right | 22.02 | 19.72 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM2 | 518598 | Inner Full      | 22.66 | 20.36 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM2 | 518598 | Inner 1RB Left  | 22.09 | 19.79 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM2 | 518598 | Inner 1RB Right | 21.98 | 19.68 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM2 | 531996 | Inner Full      | 22.57 | 20.27 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM2 | 531996 | Inner 1RB Left  | 22.12 | 19.82 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM2 | 531996 | Inner 1RB Right | 22.23 | 19.93 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM3 | 505200 | Inner Full      | 21.29 | 18.99 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM3 | 505200 | Inner 1RB Left  | 20.9  | 18.60 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM3 | 505200 | Inner 1RB Right | 21.32 | 19.02 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM3 | 518598 | Inner Full      | 21.64 | 19.34 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM3 | 518598 | Inner 1RB Left  | 21.01 | 18.71 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM3 | 518598 | Inner 1RB Right | 20.9  | 18.60 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM3 | 531996 | Inner Full      | 21.51 | 19.21 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM3 | 531996 | Inner 1RB Left  | 21.25 | 18.95 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM3 | 531996 | Inner 1RB Right | 21.58 | 19.28 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM4 | 505200 | Inner Full      | 19.74 | 17.44 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM4 | 505200 | Inner 1RB Left  | 19.09 | 16.79 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM4 | 505200 | Inner 1RB Right | 19.15 | 16.85 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM4 | 518598 | Inner Full      | 20.09 | 17.79 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM4 | 518598 | Inner 1RB Left  | 19.25 | 16.95 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM4 | 518598 | Inner 1RB Right | 19.27 | 16.97 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM4 | 531996 | Inner Full      | 20.09 | 17.79 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM4 | 531996 | Inner 1RB Left  | 19.43 | 17.13 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM4 | 531996 | Inner 1RB Right | 19.53 | 17.23 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM5 | 505200 | Inner Full      | 17.86 | 15.56 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM5 | 505200 | Inner 1RB Left  | 17.57 | 15.27 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM5 | 505200 | Inner 1RB Right | 17.66 | 15.36 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM5 | 518598 | Inner Full      | 18.24 | 15.94 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM5 | 518598 | Inner 1RB Left  | 17.77 | 15.47 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM5 | 518598 | Inner 1RB Right | 17.75 | 15.45 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM5 | 531996 | Inner Full      | 18.2  | 15.90 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM5 | 531996 | Inner 1RB Left  | 17.96 | 15.66 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM5 | 531996 | Inner 1RB Right | 18.03 | 15.73 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM6 | 505200 | Inner Full      | 22.29 | 19.99 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM6 | 505200 | Inner 1RB Left  | 22.02 | 19.72 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)





|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 60MHz | 30KHz | TM6 | 505200 | Inner 1RB Right | 22.03 | 19.73 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM6 | 518598 | Inner Full      | 22.67 | 20.37 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM6 | 518598 | Inner 1RB Left  | 22.1  | 19.80 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM6 | 518598 | Inner 1RB Right | 21.92 | 19.62 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM6 | 531996 | Inner Full      | 22.59 | 20.29 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM6 | 531996 | Inner 1RB Left  | 22.15 | 19.85 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM6 | 531996 | Inner 1RB Right | 22.18 | 19.88 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM7 | 505200 | Inner Full      | 21.34 | 19.04 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM7 | 505200 | Inner 1RB Left  | 21.26 | 18.96 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM7 | 505200 | Inner 1RB Right | 21.33 | 19.03 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM7 | 518598 | Inner Full      | 21.63 | 19.33 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM7 | 518598 | Inner 1RB Left  | 21.03 | 18.73 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM7 | 518598 | Inner 1RB Right | 20.9  | 18.60 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM7 | 531996 | Inner Full      | 21.54 | 19.24 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM7 | 531996 | Inner 1RB Left  | 21.55 | 19.25 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM7 | 531996 | Inner 1RB Right | 21.27 | 18.97 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM8 | 505200 | Inner Full      | 19.74 | 17.44 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM8 | 505200 | Inner 1RB Left  | 19.15 | 16.85 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM8 | 505200 | Inner 1RB Right | 19.27 | 16.97 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM8 | 518598 | Inner Full      | 20.14 | 17.84 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM8 | 518598 | Inner 1RB Left  | 19.35 | 17.05 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM8 | 518598 | Inner 1RB Right | 19.24 | 16.94 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM8 | 531996 | Inner Full      | 20.08 | 17.78 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM8 | 531996 | Inner 1RB Left  | 19.39 | 17.09 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM8 | 531996 | Inner 1RB Right | 19.49 | 17.19 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM9 | 505200 | Inner Full      | 17.86 | 15.56 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM9 | 505200 | Inner 1RB Left  | 17.58 | 15.28 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM9 | 505200 | Inner 1RB Right | 17.66 | 15.36 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM9 | 518598 | Inner Full      | 18.26 | 15.96 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM9 | 518598 | Inner 1RB Left  | 17.78 | 15.48 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM9 | 518598 | Inner 1RB Right | 17.75 | 15.45 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM9 | 531996 | Inner Full      | 18.28 | 15.98 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM9 | 531996 | Inner 1RB Left  | 18.04 | 15.74 | 33.00 | PASS |
| N41 | 60MHz | 30KHz | TM9 | 531996 | Inner 1RB Right | 18.41 | 16.11 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM1 | 507204 | Inner Full      | 22.26 | 19.96 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM1 | 507204 | Inner 1RB Left  | 22.04 | 19.74 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM1 | 507204 | Inner 1RB Right | 21.73 | 19.43 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM1 | 518598 | Inner Full      | 22.67 | 20.37 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM1 | 518598 | Inner 1RB Left  | 21.92 | 19.62 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM1 | 518598 | Inner 1RB Right | 22.11 | 19.81 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM1 | 529998 | Inner Full      | 22.85 | 20.55 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM1 | 529998 | Inner 1RB Left  | 22.02 | 19.72 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM1 | 529998 | Inner 1RB Right | 22.22 | 19.92 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM2 | 507204 | Inner Full      | 22.34 | 20.04 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM2 | 507204 | Inner 1RB Left  | 21.77 | 19.47 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM2 | 507204 | Inner 1RB Right | 21.65 | 19.35 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM2 | 518598 | Inner Full      | 22.73 | 20.43 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM2 | 518598 | Inner 1RB Left  | 21.83 | 19.53 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 80MHz | 30KHz | TM2 | 518598 | Inner 1RB Right | 22.12 | 19.82 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM2 | 529998 | Inner Full      | 22.85 | 20.55 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM2 | 529998 | Inner 1RB Left  | 21.91 | 19.61 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM2 | 529998 | Inner 1RB Right | 22.3  | 20.00 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM3 | 507204 | Inner Full      | 21.33 | 19.03 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM3 | 507204 | Inner 1RB Left  | 20.72 | 18.42 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM3 | 507204 | Inner 1RB Right | 20.69 | 18.39 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM3 | 518598 | Inner Full      | 21.73 | 19.43 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM3 | 518598 | Inner 1RB Left  | 20.81 | 18.51 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM3 | 518598 | Inner 1RB Right | 21.58 | 19.28 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM3 | 529998 | Inner Full      | 21.88 | 19.58 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM3 | 529998 | Inner 1RB Left  | 20.97 | 18.67 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM3 | 529998 | Inner 1RB Right | 21.28 | 18.98 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM4 | 507204 | Inner Full      | 19.8  | 17.50 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM4 | 507204 | Inner 1RB Left  | 19.09 | 16.79 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM4 | 507204 | Inner 1RB Right | 18.93 | 16.63 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM4 | 518598 | Inner Full      | 20.13 | 17.83 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM4 | 518598 | Inner 1RB Left  | 19.02 | 16.72 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM4 | 518598 | Inner 1RB Right | 19.49 | 17.19 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM4 | 529998 | Inner Full      | 20.36 | 18.06 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM4 | 529998 | Inner 1RB Left  | 19.19 | 16.89 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM4 | 529998 | Inner 1RB Right | 19.61 | 17.31 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM5 | 507204 | Inner Full      | 17.97 | 15.67 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM5 | 507204 | Inner 1RB Left  | 17.47 | 15.17 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM5 | 507204 | Inner 1RB Right | 17.38 | 15.08 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM5 | 518598 | Inner Full      | 18.42 | 16.12 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM5 | 518598 | Inner 1RB Left  | 17.63 | 15.33 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM5 | 518598 | Inner 1RB Right | 18    | 15.70 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM5 | 529998 | Inner Full      | 18.54 | 16.24 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM5 | 529998 | Inner 1RB Left  | 17.84 | 15.54 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM5 | 529998 | Inner 1RB Right | 18.08 | 15.78 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM6 | 507204 | Inner Full      | 22.35 | 20.05 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM6 | 507204 | Inner 1RB Left  | 21.76 | 19.46 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM6 | 507204 | Inner 1RB Right | 21.56 | 19.26 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM6 | 518598 | Inner Full      | 22.76 | 20.46 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM6 | 518598 | Inner 1RB Left  | 21.92 | 19.62 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM6 | 518598 | Inner 1RB Right | 22.28 | 19.98 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM6 | 529998 | Inner Full      | 22.93 | 20.63 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM6 | 529998 | Inner 1RB Left  | 21.92 | 19.62 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM6 | 529998 | Inner 1RB Right | 22.27 | 19.97 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM7 | 507204 | Inner Full      | 21.32 | 19.02 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM7 | 507204 | Inner 1RB Left  | 20.72 | 18.42 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM7 | 507204 | Inner 1RB Right | 20.77 | 18.47 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM7 | 518598 | Inner Full      | 21.68 | 19.38 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM7 | 518598 | Inner 1RB Left  | 20.81 | 18.51 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM7 | 518598 | Inner 1RB Right | 21.16 | 18.86 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM7 | 529998 | Inner Full      | 21.9  | 19.60 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM7 | 529998 | Inner 1RB Left  | 20.97 | 18.67 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 80MHz | 30KHz | TM7 | 529998 | Inner 1RB Right | 21.67 | 19.37 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM8 | 507204 | Inner Full      | 19.74 | 17.44 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM8 | 507204 | Inner 1RB Left  | 19.04 | 16.74 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM8 | 507204 | Inner 1RB Right | 18.97 | 16.67 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM8 | 518598 | Inner Full      | 20.2  | 17.90 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM8 | 518598 | Inner 1RB Left  | 19.13 | 16.83 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM8 | 518598 | Inner 1RB Right | 19.48 | 17.18 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM8 | 529998 | Inner Full      | 20.4  | 18.10 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM8 | 529998 | Inner 1RB Left  | 19.29 | 16.99 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM8 | 529998 | Inner 1RB Right | 19.46 | 17.16 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM9 | 507204 | Inner Full      | 17.97 | 15.67 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM9 | 507204 | Inner 1RB Left  | 17.41 | 15.11 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM9 | 507204 | Inner 1RB Right | 17.46 | 15.16 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM9 | 518598 | Inner Full      | 18.34 | 16.04 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM9 | 518598 | Inner 1RB Left  | 17.68 | 15.38 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM9 | 518598 | Inner 1RB Right | 18.07 | 15.77 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM9 | 529998 | Inner Full      | 18.58 | 16.28 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM9 | 529998 | Inner 1RB Left  | 17.78 | 15.48 | 33.00 | PASS |
| N41 | 80MHz | 30KHz | TM9 | 529998 | Inner 1RB Right | 18.16 | 15.86 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM1 | 508200 | Inner Full      | 22.28 | 19.98 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM1 | 508200 | Inner 1RB Left  | 21.91 | 19.61 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM1 | 508200 | Inner 1RB Right | 21.81 | 19.51 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM1 | 518598 | Inner Full      | 22.72 | 20.42 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM1 | 518598 | Inner 1RB Left  | 21.67 | 19.37 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM1 | 518598 | Inner 1RB Right | 22.16 | 19.86 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM1 | 528996 | Inner Full      | 22.8  | 20.50 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM1 | 528996 | Inner 1RB Left  | 22.11 | 19.81 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM1 | 528996 | Inner 1RB Right | 22.19 | 19.89 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM2 | 508200 | Inner Full      | 22.35 | 20.05 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM2 | 508200 | Inner 1RB Left  | 21.6  | 19.30 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM2 | 508200 | Inner 1RB Right | 21.64 | 19.34 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM2 | 518598 | Inner Full      | 22.69 | 20.39 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM2 | 518598 | Inner 1RB Left  | 21.65 | 19.35 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM2 | 518598 | Inner 1RB Right | 22.16 | 19.86 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM2 | 528996 | Inner Full      | 22.86 | 20.56 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM2 | 528996 | Inner 1RB Left  | 22.19 | 19.89 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM2 | 528996 | Inner 1RB Right | 22.23 | 19.93 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM3 | 508200 | Inner Full      | 21.4  | 19.10 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM3 | 508200 | Inner 1RB Left  | 20.62 | 18.32 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM3 | 508200 | Inner 1RB Right | 20.71 | 18.41 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM3 | 518598 | Inner Full      | 21.72 | 19.42 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM3 | 518598 | Inner 1RB Left  | 20.97 | 18.67 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM3 | 518598 | Inner 1RB Right | 21.58 | 19.28 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM3 | 528996 | Inner Full      | 21.88 | 19.58 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM3 | 528996 | Inner 1RB Left  | 21.53 | 19.23 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM3 | 528996 | Inner 1RB Right | 21.5  | 19.20 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM4 | 508200 | Inner Full      | 19.81 | 17.51 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM4 | 508200 | Inner 1RB Left  | 18.95 | 16.65 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)





|     |       |       |     |        |                 |       |       |       |      |
|-----|-------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 90MHz | 30KHz | TM4 | 508200 | Inner 1RB Right | 19.01 | 16.71 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM4 | 518598 | Inner Full      | 20.2  | 17.90 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM4 | 518598 | Inner 1RB Left  | 18.9  | 16.60 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM4 | 518598 | Inner 1RB Right | 19.44 | 17.14 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM4 | 528996 | Inner Full      | 20.33 | 18.03 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM4 | 528996 | Inner 1RB Left  | 19.37 | 17.07 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM4 | 528996 | Inner 1RB Right | 19.35 | 17.05 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM5 | 508200 | Inner Full      | 17.95 | 15.65 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM5 | 508200 | Inner 1RB Left  | 17.44 | 15.14 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM5 | 508200 | Inner 1RB Right | 17.47 | 15.17 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM5 | 518598 | Inner Full      | 18.36 | 16.06 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM5 | 518598 | Inner 1RB Left  | 17.51 | 15.21 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM5 | 518598 | Inner 1RB Right | 18.14 | 15.84 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM5 | 528996 | Inner Full      | 18.45 | 16.15 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM5 | 528996 | Inner 1RB Left  | 18.09 | 15.79 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM5 | 528996 | Inner 1RB Right | 18.06 | 15.76 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM6 | 508200 | Inner Full      | 22.3  | 20.00 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM6 | 508200 | Inner 1RB Left  | 21.63 | 19.33 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM6 | 508200 | Inner 1RB Right | 21.64 | 19.34 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM6 | 518598 | Inner Full      | 22.75 | 20.45 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM6 | 518598 | Inner 1RB Left  | 21.59 | 19.29 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM6 | 518598 | Inner 1RB Right | 22.3  | 20.00 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM6 | 528996 | Inner Full      | 22.84 | 20.54 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM6 | 528996 | Inner 1RB Left  | 22.27 | 19.97 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM6 | 528996 | Inner 1RB Right | 22.21 | 19.91 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM7 | 508200 | Inner Full      | 21.39 | 19.09 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM7 | 508200 | Inner 1RB Left  | 20.61 | 18.31 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM7 | 508200 | Inner 1RB Right | 20.73 | 18.43 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM7 | 518598 | Inner Full      | 21.79 | 19.49 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM7 | 518598 | Inner 1RB Left  | 20.95 | 18.65 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM7 | 518598 | Inner 1RB Right | 21.56 | 19.26 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM7 | 528996 | Inner Full      | 21.87 | 19.57 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM7 | 528996 | Inner 1RB Left  | 21.16 | 18.86 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM7 | 528996 | Inner 1RB Right | 21.52 | 19.22 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM8 | 508200 | Inner Full      | 19.79 | 17.49 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM8 | 508200 | Inner 1RB Left  | 18.95 | 16.65 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM8 | 508200 | Inner 1RB Right | 18.97 | 16.67 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM8 | 518598 | Inner Full      | 20.17 | 17.87 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM8 | 518598 | Inner 1RB Left  | 18.84 | 16.54 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM8 | 518598 | Inner 1RB Right | 19.52 | 17.22 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM8 | 528996 | Inner Full      | 20.34 | 18.04 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM8 | 528996 | Inner 1RB Left  | 19.48 | 17.18 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM8 | 528996 | Inner 1RB Right | 19.43 | 17.13 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM9 | 508200 | Inner Full      | 17.99 | 15.69 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM9 | 508200 | Inner 1RB Left  | 17.45 | 15.15 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM9 | 508200 | Inner 1RB Right | 17.55 | 15.25 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM9 | 518598 | Inner Full      | 18.41 | 16.11 | 33.00 | PASS |
| N41 | 90MHz | 30KHz | TM9 | 518598 | Inner 1RB Left  | 17.51 | 15.21 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |        |       |     |        |                 |       |       |       |      |
|-----|--------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 90MHz  | 30KHz | TM9 | 518598 | Inner 1RB Right | 18.1  | 15.80 | 33.00 | PASS |
| N41 | 90MHz  | 30KHz | TM9 | 528996 | Inner Full      | 18.42 | 16.12 | 33.00 | PASS |
| N41 | 90MHz  | 30KHz | TM9 | 528996 | Inner 1RB Left  | 18.02 | 15.72 | 33.00 | PASS |
| N41 | 90MHz  | 30KHz | TM9 | 528996 | Inner 1RB Right | 17.99 | 15.69 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM1 | 509202 | Inner Full      | 22.29 | 19.99 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM1 | 509202 | Inner 1RB Left  | 21.69 | 19.39 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM1 | 509202 | Inner 1RB Right | 21.99 | 19.69 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM1 | 518598 | Inner Full      | 22.61 | 20.31 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM1 | 518598 | Inner 1RB Left  | 21.49 | 19.19 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM1 | 518598 | Inner 1RB Right | 22.07 | 19.77 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM1 | 528000 | Inner Full      | 22.72 | 20.42 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM1 | 528000 | Inner 1RB Left  | 21.96 | 19.66 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM1 | 528000 | Inner 1RB Right | 22.13 | 19.83 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM2 | 509202 | Inner Full      | 22.36 | 20.06 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM2 | 509202 | Inner 1RB Left  | 21.38 | 19.08 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM2 | 509202 | Inner 1RB Right | 21.79 | 19.49 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM2 | 518598 | Inner Full      | 22.63 | 20.33 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM2 | 518598 | Inner 1RB Left  | 21.22 | 18.92 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM2 | 518598 | Inner 1RB Right | 21.92 | 19.62 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM2 | 528000 | Inner Full      | 22.78 | 20.48 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM2 | 528000 | Inner 1RB Left  | 21.71 | 19.41 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM2 | 528000 | Inner 1RB Right | 21.9  | 19.60 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM3 | 509202 | Inner Full      | 21.41 | 19.11 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM3 | 509202 | Inner 1RB Left  | 20.43 | 18.13 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM3 | 509202 | Inner 1RB Right | 20.88 | 18.58 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM3 | 518598 | Inner Full      | 21.65 | 19.35 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM3 | 518598 | Inner 1RB Left  | 20.28 | 17.98 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM3 | 518598 | Inner 1RB Right | 21.02 | 18.72 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM3 | 528000 | Inner Full      | 21.81 | 19.51 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM3 | 528000 | Inner 1RB Left  | 20.85 | 18.55 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM3 | 528000 | Inner 1RB Right | 20.98 | 18.68 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM4 | 509202 | Inner Full      | 19.8  | 17.50 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM4 | 509202 | Inner 1RB Left  | 18.74 | 16.44 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM4 | 509202 | Inner 1RB Right | 19.13 | 16.83 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM4 | 518598 | Inner Full      | 20.18 | 17.88 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM4 | 518598 | Inner 1RB Left  | 18.62 | 16.32 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM4 | 518598 | Inner 1RB Right | 19.31 | 17.01 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM4 | 528000 | Inner Full      | 20.2  | 17.90 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM4 | 528000 | Inner 1RB Left  | 19.15 | 16.85 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM4 | 528000 | Inner 1RB Right | 19.3  | 17.00 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM5 | 509202 | Inner Full      | 17.97 | 15.67 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM5 | 509202 | Inner 1RB Left  | 17.24 | 14.94 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM5 | 509202 | Inner 1RB Right | 17.67 | 15.37 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM5 | 518598 | Inner Full      | 18.38 | 16.08 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM5 | 518598 | Inner 1RB Left  | 17.07 | 14.77 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM5 | 518598 | Inner 1RB Right | 17.86 | 15.56 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM5 | 528000 | Inner Full      | 18.41 | 16.11 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM5 | 528000 | Inner 1RB Left  | 17.69 | 15.39 | 33.00 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |        |       |     |        |                 |       |       |       |      |
|-----|--------|-------|-----|--------|-----------------|-------|-------|-------|------|
| N41 | 100MHz | 30KHz | TM5 | 528000 | Inner 1RB Right | 17.83 | 15.53 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM6 | 509202 | Inner Full      | 22.32 | 20.02 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM6 | 509202 | Inner 1RB Left  | 21.39 | 19.09 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM6 | 509202 | Inner 1RB Right | 21.74 | 19.44 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM6 | 518598 | Inner Full      | 22.7  | 20.40 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM6 | 518598 | Inner 1RB Left  | 21.15 | 18.85 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM6 | 518598 | Inner 1RB Right | 21.91 | 19.61 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM6 | 528000 | Inner Full      | 22.79 | 20.49 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM6 | 528000 | Inner 1RB Left  | 21.74 | 19.44 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM6 | 528000 | Inner 1RB Right | 21.91 | 19.61 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM7 | 509202 | Inner Full      | 21.36 | 19.06 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM7 | 509202 | Inner 1RB Left  | 20.36 | 18.06 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM7 | 509202 | Inner 1RB Right | 20.87 | 18.57 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM7 | 518598 | Inner Full      | 21.72 | 19.42 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM7 | 518598 | Inner 1RB Left  | 20.27 | 17.97 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM7 | 518598 | Inner 1RB Right | 21.01 | 18.71 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM7 | 528000 | Inner Full      | 21.81 | 19.51 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM7 | 528000 | Inner 1RB Left  | 20.79 | 18.49 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM7 | 528000 | Inner 1RB Right | 20.97 | 18.67 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM8 | 509202 | Inner Full      | 19.87 | 17.57 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM8 | 509202 | Inner 1RB Left  | 18.73 | 16.43 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM8 | 509202 | Inner 1RB Right | 19.18 | 16.88 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM8 | 518598 | Inner Full      | 20.19 | 17.89 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM8 | 518598 | Inner 1RB Left  | 18.62 | 16.32 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM8 | 518598 | Inner 1RB Right | 19.31 | 17.01 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM8 | 528000 | Inner Full      | 20.22 | 17.92 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM8 | 528000 | Inner 1RB Left  | 19.12 | 16.82 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM8 | 528000 | Inner 1RB Right | 19.31 | 17.01 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM9 | 509202 | Inner Full      | 18.05 | 15.75 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM9 | 509202 | Inner 1RB Left  | 17.17 | 14.87 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM9 | 509202 | Inner 1RB Right | 17.65 | 15.35 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM9 | 518598 | Inner Full      | 18.32 | 16.02 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM9 | 518598 | Inner 1RB Left  | 17.06 | 14.76 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM9 | 518598 | Inner 1RB Right | 17.86 | 15.56 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM9 | 528000 | Inner Full      | 18.42 | 16.12 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM9 | 528000 | Inner 1RB Left  | 17.65 | 15.35 | 33.00 | PASS |
| N41 | 100MHz | 30KHz | TM9 | 528000 | Inner 1RB Right | 17.87 | 15.57 | 33.00 | PASS |

Note:

a: For getting the EIRP (Efficient Isotropic Radiated Power) in substitution method, the following formula should be taken to calculate it,

$EIRP [dBm] = \text{Conducted Power} [dBm] + \text{Gain} [dBi]$

$ERP [dBm] = \text{Conducted Power} [dBm] + \text{Gain} [dBi] - 2.15$



SGS-CSTC Standards Technical Services Co., Ltd.  
Shenzhen Branch

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.  
Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn  
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com




## 2 Peak-to-Average Ratio

### 2.1 Test Results

| NR Band | Bandwidth | SCS   | Modulation | Channel | RB Config  | Result (dB) | Limit (dBm) | Verdict |
|---------|-----------|-------|------------|---------|------------|-------------|-------------|---------|
| N41     | 100MHz    | 30KHz | TM1        | 518598  | Outer Full | 4.34        | 13          | PASS    |
| N41     | 100MHz    | 30KHz | TM6        | 518598  | Outer Full | 8.04        | 13          | PASS    |

### 2.2 Test Plots

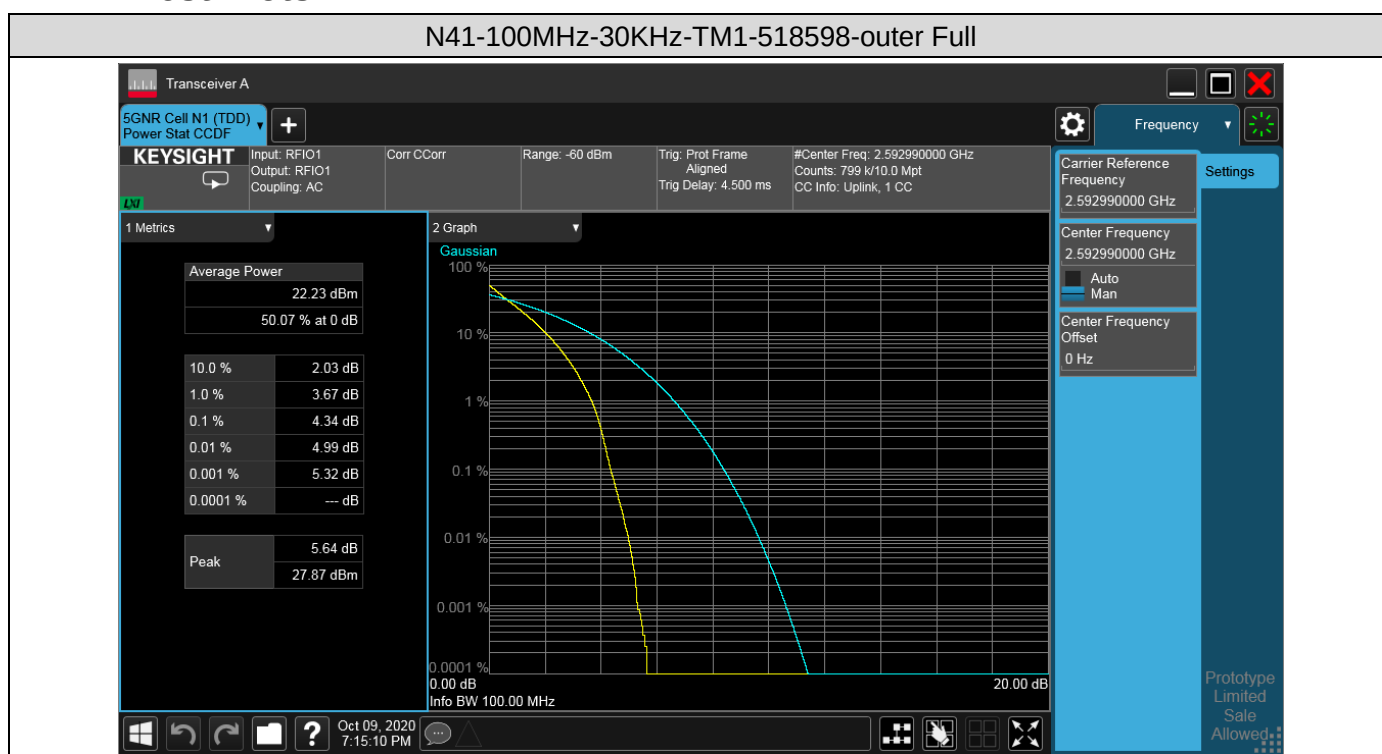


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

SGS-CSTC Standards Technical Services Co., Ltd.  
Shenzhen Branch Inspection & Testing Laboratory

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn  
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

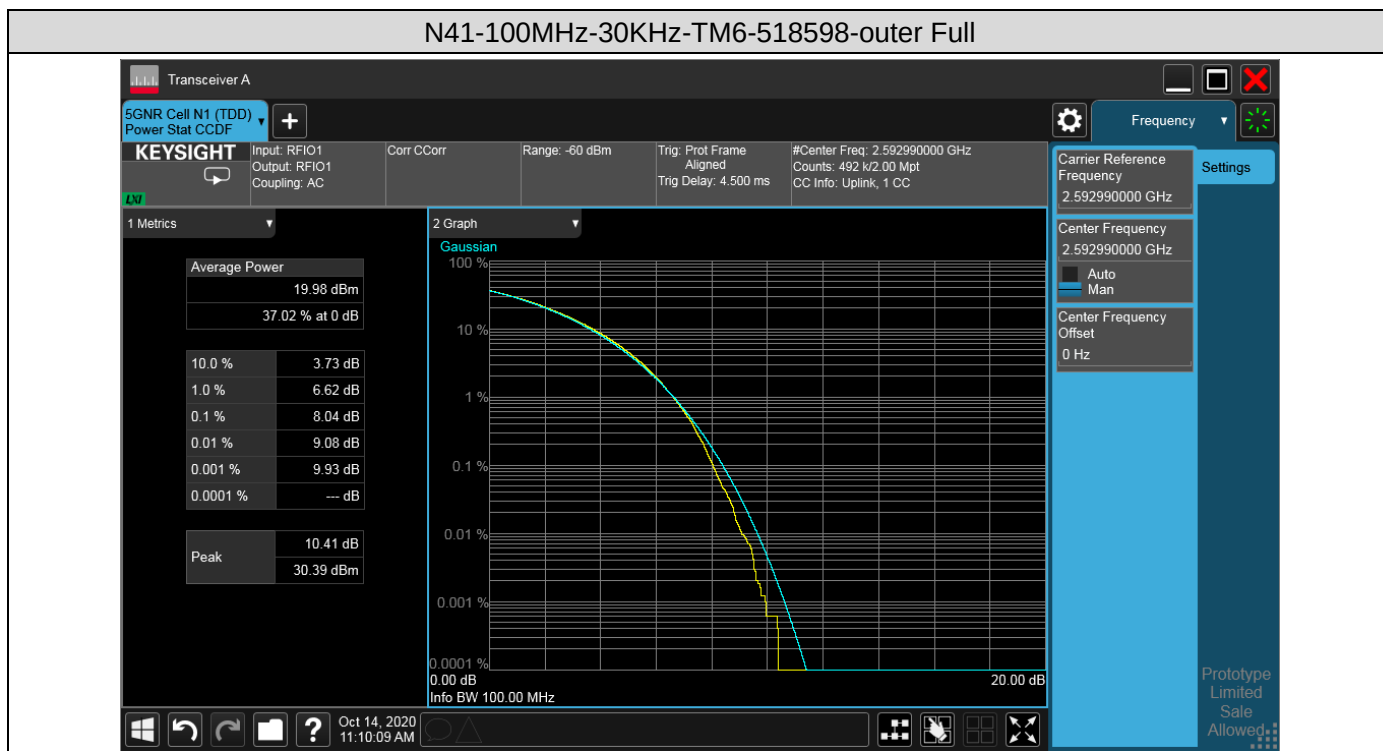

## REMARK:

All antenna and all modulation had been tested, but only the worst case data displayed in this report




### 3 Modulation Characteristics

#### 3.1 Test Plots

##### 3.1.1 Test Band = N41


##### 3.1.1.1 Test Mode = TM1 100MHz

##### 3.1.1.1.1 Test Channel = MCH

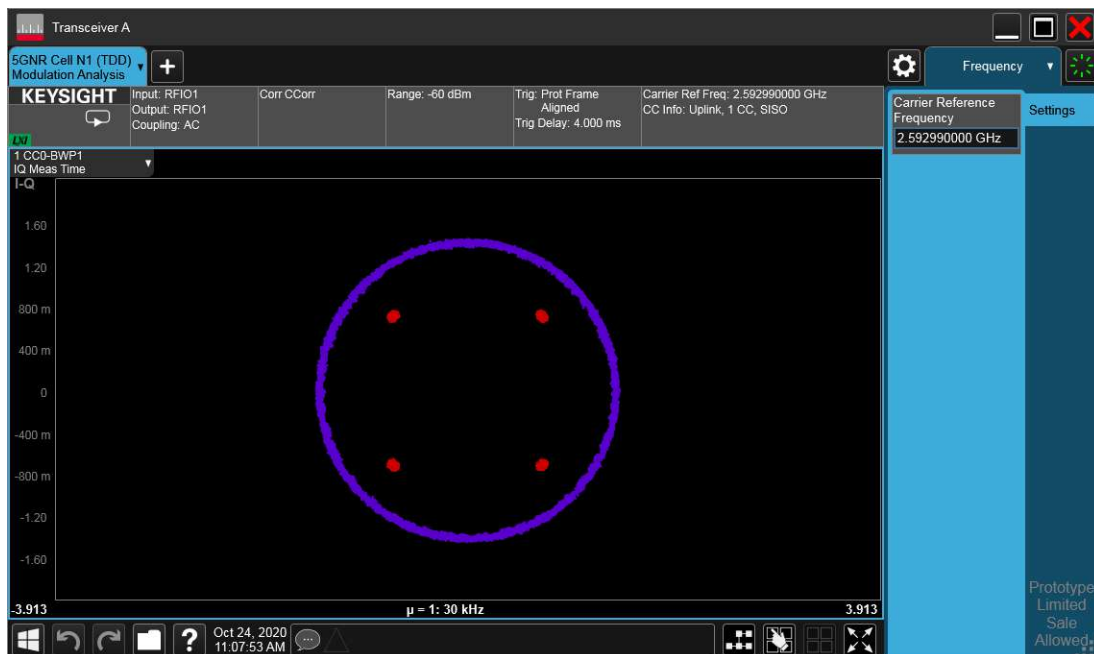

##### 3.1.1.2 Test Mode = TM2 100MHz


##### 3.1.1.2.1 Test Channel = MCH

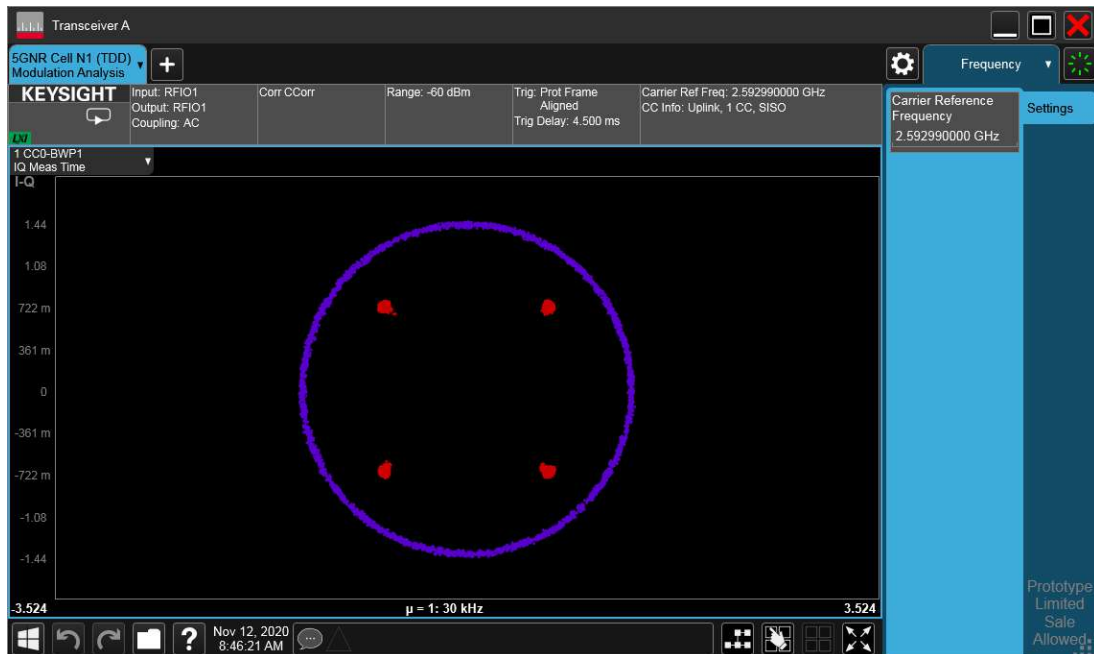




## 3.1.1.3 Test Mode = TM3 100MHz

## 3.1.1.3.1 Test Channel = MCH

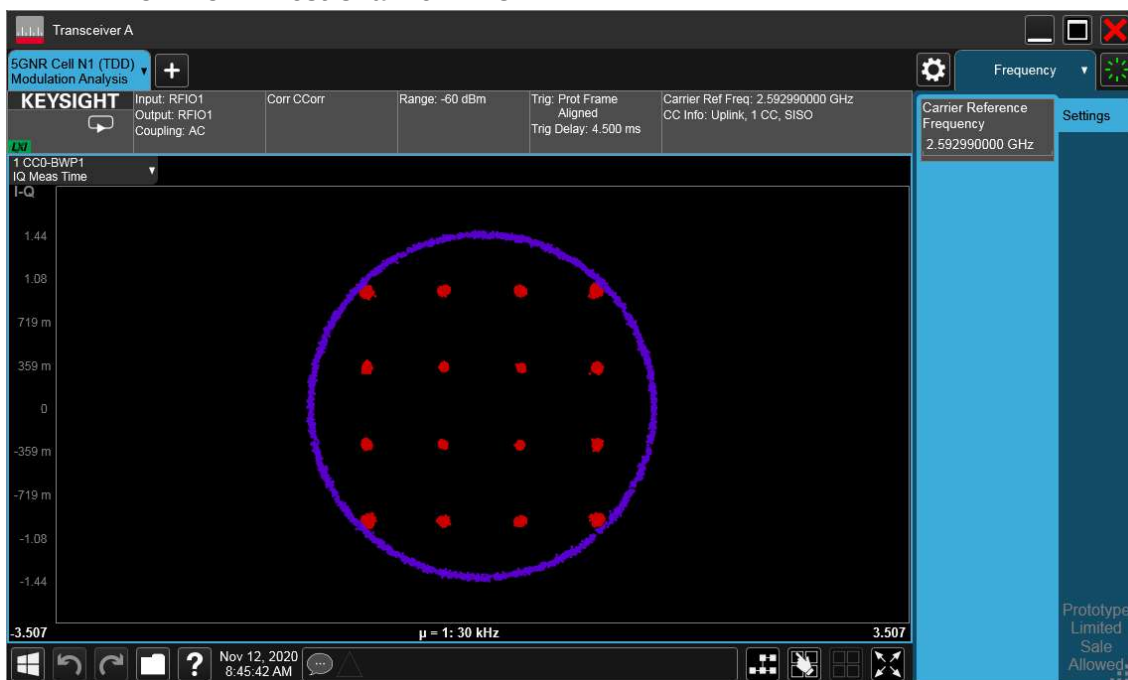


## 3.1.1.4 Test Mode = TM4 100MHz

## 3.1.1.4.1 Test Channel = MCH

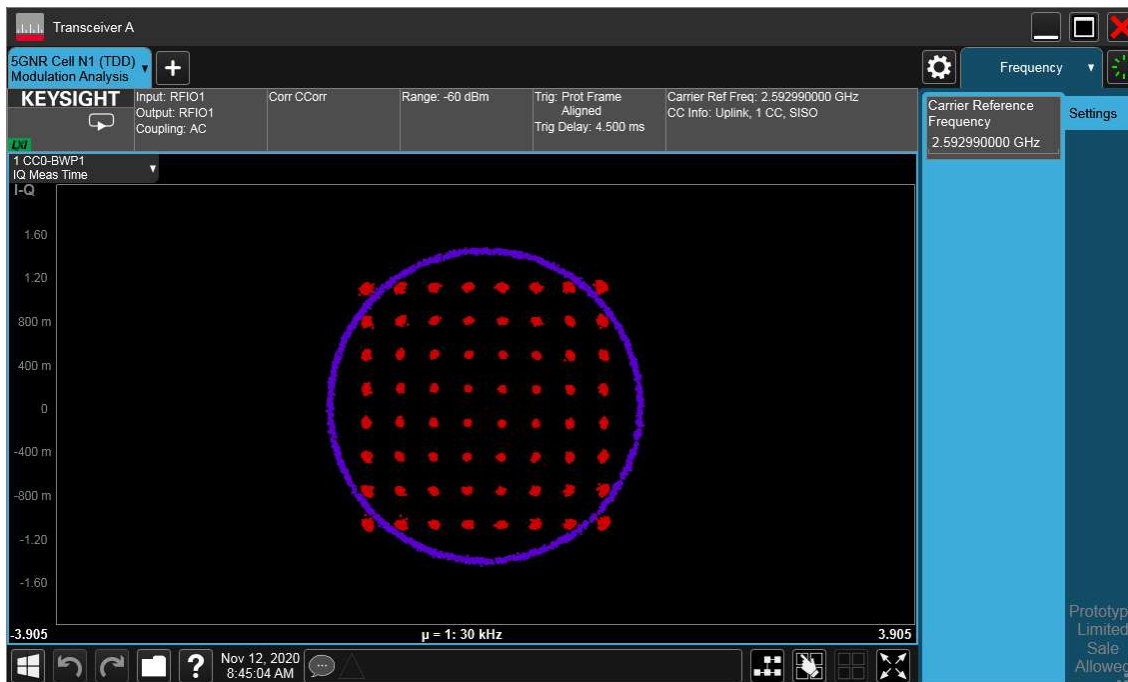


## 3.1.1.5 Test Mode = TM5 100MHz

## 3.1.1.5.1 Test Channel = MCH

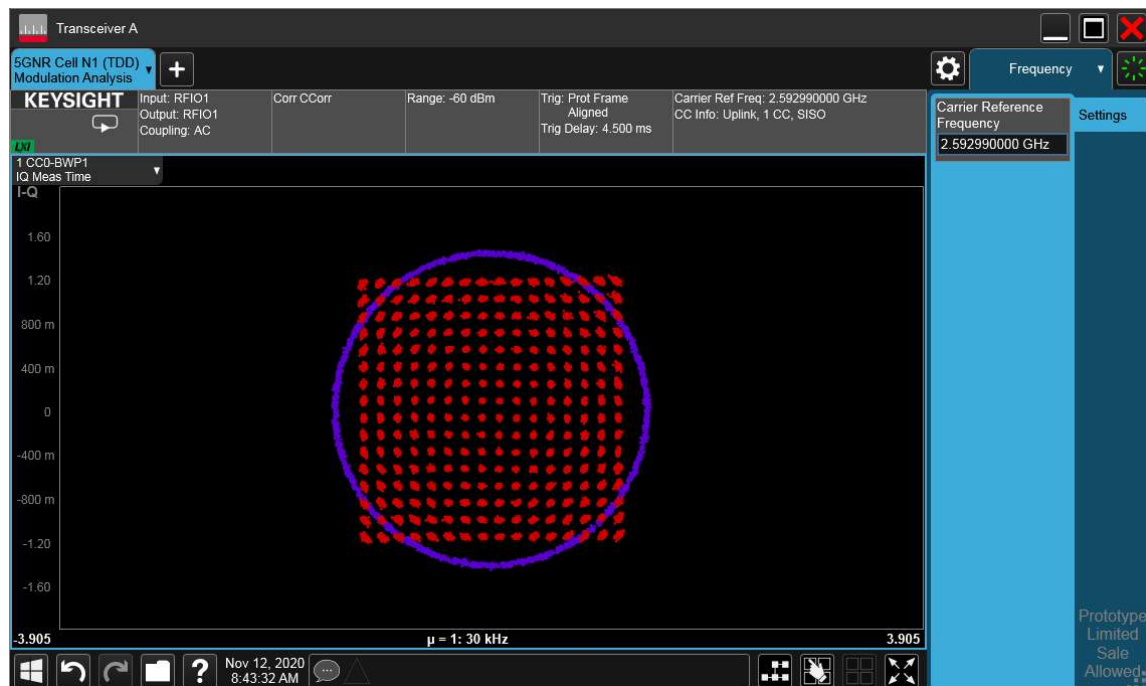

## 3.1.1.6 Test Mode = TM6 100MHz

## 3.1.1.6.1 Test Channel = MCH

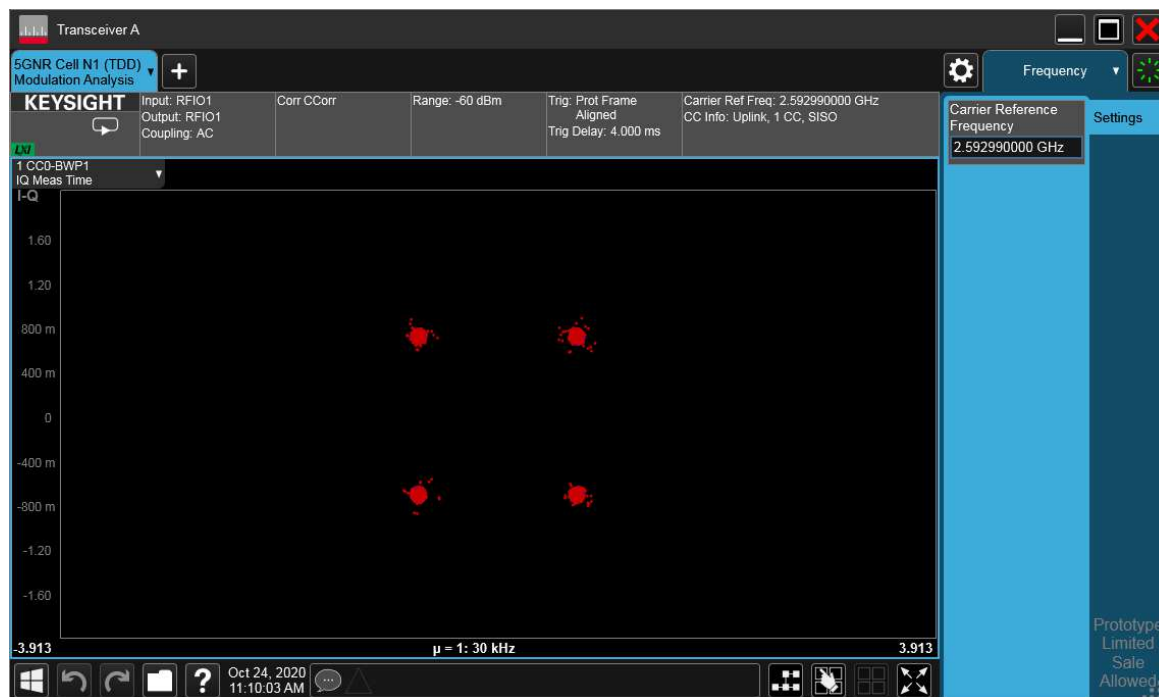

## REMARK:

All antenna and all modulation had been tested, but only the worst case data displayed in this report



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn  
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

## 4 Occupied Bandwidth & 26dB Emission Bandwidth

### 4.1 Test Results

| NR Band | Bandwidth | SCS   | Modulation | Channel | RB Config  | OBW (MHz) | EBW (MHz) | Verdict |
|---------|-----------|-------|------------|---------|------------|-----------|-----------|---------|
| N41     | 10MHz     | 15KHz | TM1        | 518601  | Outer Full | 8.95      | 9.54      | PASS    |
| N41     | 10MHz     | 15KHz | TM2        | 518601  | Outer Full | 8.90      | 9.49      | PASS    |
| N41     | 10MHz     | 15KHz | TM3        | 518601  | Outer Full | 8.91      | 9.60      | PASS    |
| N41     | 10MHz     | 15KHz | TM4        | 518601  | Outer Full | 8.90      | 9.55      | PASS    |
| N41     | 10MHz     | 15KHz | TM5        | 518601  | Outer Full | 8.95      | 9.52      | PASS    |
| N41     | 10MHz     | 15KHz | TM6        | 518601  | Outer Full | 9.29      | 9.93      | PASS    |
| N41     | 10MHz     | 15KHz | TM7        | 518601  | Outer Full | 9.28      | 9.86      | PASS    |
| N41     | 10MHz     | 15KHz | TM8        | 518601  | Outer Full | 9.27      | 9.88      | PASS    |
| N41     | 10MHz     | 15KHz | TM9        | 518601  | Outer Full | 9.30      | 10.17     | PASS    |
| N41     | 15MHz     | 15KHz | TM1        | 518601  | Outer Full | 13.40     | 14.25     | PASS    |
| N41     | 15MHz     | 15KHz | TM2        | 518601  | Outer Full | 13.41     | 14.21     | PASS    |
| N41     | 15MHz     | 15KHz | TM3        | 518601  | Outer Full | 13.40     | 14.23     | PASS    |
| N41     | 15MHz     | 15KHz | TM4        | 518601  | Outer Full | 13.38     | 14.21     | PASS    |
| N41     | 15MHz     | 15KHz | TM5        | 518601  | Outer Full | 13.39     | 14.49     | PASS    |
| N41     | 15MHz     | 15KHz | TM6        | 518601  | Outer Full | 14.08     | 14.77     | PASS    |
| N41     | 15MHz     | 15KHz | TM7        | 518601  | Outer Full | 14.10     | 14.76     | PASS    |
| N41     | 15MHz     | 15KHz | TM8        | 518601  | Outer Full | 14.11     | 14.82     | PASS    |
| N41     | 15MHz     | 15KHz | TM9        | 518601  | Outer Full | 14.12     | 14.90     | PASS    |
| N41     | 20MHz     | 15KHz | TM1        | 518601  | Outer Full | 17.91     | 18.95     | PASS    |
| N41     | 20MHz     | 15KHz | TM2        | 518601  | Outer Full | 17.87     | 18.84     | PASS    |
| N41     | 20MHz     | 15KHz | TM3        | 518601  | Outer Full | 17.87     | 18.94     | PASS    |
| N41     | 20MHz     | 15KHz | TM4        | 518601  | Outer Full | 17.86     | 18.94     | PASS    |
| N41     | 20MHz     | 15KHz | TM5        | 518601  | Outer Full | 17.88     | 19.01     | PASS    |
| N41     | 20MHz     | 15KHz | TM6        | 518601  | Outer Full | 18.92     | 19.99     | PASS    |
| N41     | 20MHz     | 15KHz | TM7        | 518601  | Outer Full | 18.93     | 19.92     | PASS    |
| N41     | 20MHz     | 15KHz | TM8        | 518601  | Outer Full | 18.91     | 20.20     | PASS    |
| N41     | 20MHz     | 15KHz | TM9        | 518601  | Outer Full | 18.91     | 19.83     | PASS    |
| N41     | 40MHz     | 15KHz | TM1        | 518601  | Outer Full | 38.57     | 40.11     | PASS    |
| N41     | 40MHz     | 15KHz | TM2        | 518601  | Outer Full | 38.53     | 41.42     | PASS    |
| N41     | 40MHz     | 15KHz | TM3        | 518601  | Outer Full | 38.55     | 40.02     | PASS    |
| N41     | 40MHz     | 15KHz | TM4        | 518601  | Outer Full | 38.55     | 40.11     | PASS    |
| N41     | 40MHz     | 15KHz | TM5        | 518601  | Outer Full | 38.58     | 40.16     | PASS    |
| N41     | 40MHz     | 15KHz | TM6        | 518601  | Outer Full | 38.57     | 39.96     | PASS    |
| N41     | 40MHz     | 15KHz | TM7        | 518601  | Outer Full | 38.54     | 39.96     | PASS    |
| N41     | 40MHz     | 15KHz | TM8        | 518601  | Outer Full | 38.54     | 40.03     | PASS    |
| N41     | 40MHz     | 15KHz | TM9        | 518601  | Outer Full | 38.54     | 40.23     | PASS    |
| N41     | 50MHz     | 15KHz | TM1        | 518601  | Outer Full | 48.24     | 50.24     | PASS    |
| N41     | 50MHz     | 15KHz | TM2        | 518601  | Outer Full | 48.08     | 49.83     | PASS    |
| N41     | 50MHz     | 15KHz | TM3        | 518601  | Outer Full | 48.32     | 49.82     | PASS    |







|     |       |       |     |        |            |       |       |      |
|-----|-------|-------|-----|--------|------------|-------|-------|------|
| N41 | 50MHz | 15KHz | TM4 | 518601 | Outer Full | 48.11 | 49.83 | PASS |
| N41 | 50MHz | 15KHz | TM5 | 518601 | Outer Full | 48.27 | 49.95 | PASS |
| N41 | 50MHz | 15KHz | TM6 | 518601 | Outer Full | 48.15 | 50.18 | PASS |
| N41 | 50MHz | 15KHz | TM7 | 518601 | Outer Full | 48.16 | 49.87 | PASS |
| N41 | 50MHz | 15KHz | TM8 | 518601 | Outer Full | 48.19 | 49.88 | PASS |
| N41 | 50MHz | 15KHz | TM9 | 518601 | Outer Full | 48.21 | 49.96 | PASS |
| N41 | 10MHz | 30KHz | TM1 | 518598 | Outer Full | 8.56  | 9.24  | PASS |
| N41 | 10MHz | 30KHz | TM2 | 518598 | Outer Full | 8.55  | 9.31  | PASS |
| N41 | 10MHz | 30KHz | TM3 | 518598 | Outer Full | 8.59  | 9.27  | PASS |
| N41 | 10MHz | 30KHz | TM4 | 518598 | Outer Full | 8.59  | 9.40  | PASS |
| N41 | 10MHz | 30KHz | TM5 | 518598 | Outer Full | 8.56  | 9.31  | PASS |
| N41 | 10MHz | 30KHz | TM6 | 518598 | Outer Full | 8.57  | 9.28  | PASS |
| N41 | 10MHz | 30KHz | TM7 | 518598 | Outer Full | 8.55  | 9.32  | PASS |
| N41 | 10MHz | 30KHz | TM8 | 518598 | Outer Full | 8.57  | 9.31  | PASS |
| N41 | 10MHz | 30KHz | TM9 | 518598 | Outer Full | 8.58  | 9.34  | PASS |
| N41 | 15MHz | 30KHz | TM1 | 518598 | Outer Full | 12.87 | 13.92 | PASS |
| N41 | 15MHz | 30KHz | TM2 | 518598 | Outer Full | 12.84 | 14.02 | PASS |
| N41 | 15MHz | 30KHz | TM3 | 518598 | Outer Full | 12.83 | 13.78 | PASS |
| N41 | 15MHz | 30KHz | TM4 | 518598 | Outer Full | 12.85 | 14.00 | PASS |
| N41 | 15MHz | 30KHz | TM5 | 518598 | Outer Full | 12.87 | 13.83 | PASS |
| N41 | 15MHz | 30KHz | TM6 | 518598 | Outer Full | 13.55 | 14.43 | PASS |
| N41 | 15MHz | 30KHz | TM7 | 518598 | Outer Full | 13.56 | 14.53 | PASS |
| N41 | 15MHz | 30KHz | TM8 | 518598 | Outer Full | 13.57 | 14.43 | PASS |
| N41 | 15MHz | 30KHz | TM9 | 518598 | Outer Full | 13.58 | 14.60 | PASS |
| N41 | 20MHz | 30KHz | TM1 | 518598 | Outer Full | 17.80 | 19.16 | PASS |
| N41 | 20MHz | 30KHz | TM2 | 518598 | Outer Full | 17.81 | 19.13 | PASS |
| N41 | 20MHz | 30KHz | TM3 | 518598 | Outer Full | 17.84 | 19.04 | PASS |
| N41 | 20MHz | 30KHz | TM4 | 518598 | Outer Full | 17.82 | 18.83 | PASS |
| N41 | 20MHz | 30KHz | TM5 | 518598 | Outer Full | 17.83 | 19.03 | PASS |
| N41 | 20MHz | 30KHz | TM6 | 518598 | Outer Full | 18.20 | 19.54 | PASS |
| N41 | 20MHz | 30KHz | TM7 | 518598 | Outer Full | 18.17 | 19.31 | PASS |
| N41 | 20MHz | 30KHz | TM8 | 518598 | Outer Full | 18.25 | 19.42 | PASS |
| N41 | 20MHz | 30KHz | TM9 | 518598 | Outer Full | 18.21 | 19.31 | PASS |
| N41 | 40MHz | 30KHz | TM1 | 518598 | Outer Full | 35.82 | 37.41 | PASS |
| N41 | 40MHz | 30KHz | TM2 | 518598 | Outer Full | 35.74 | 37.40 | PASS |
| N41 | 40MHz | 30KHz | TM3 | 518598 | Outer Full | 35.71 | 37.59 | PASS |
| N41 | 40MHz | 30KHz | TM4 | 518598 | Outer Full | 35.71 | 37.58 | PASS |
| N41 | 40MHz | 30KHz | TM5 | 518598 | Outer Full | 35.71 | 37.75 | PASS |
| N41 | 40MHz | 30KHz | TM6 | 518598 | Outer Full | 37.79 | 39.83 | PASS |
| N41 | 40MHz | 30KHz | TM7 | 518598 | Outer Full | 37.85 | 39.69 | PASS |
| N41 | 40MHz | 30KHz | TM8 | 518598 | Outer Full | 37.80 | 39.27 | PASS |
| N41 | 40MHz | 30KHz | TM9 | 518598 | Outer Full | 37.90 | 39.76 | PASS |
| N41 | 50MHz | 30KHz | TM1 | 518598 | Outer Full | 45.71 | 47.89 | PASS |



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



|     |        |       |     |        |            |       |        |      |
|-----|--------|-------|-----|--------|------------|-------|--------|------|
| N41 | 50MHz  | 30KHz | TM2 | 518598 | Outer Full | 45.69 | 47.64  | PASS |
| N41 | 50MHz  | 30KHz | TM3 | 518598 | Outer Full | 45.79 | 47.69  | PASS |
| N41 | 50MHz  | 30KHz | TM4 | 518598 | Outer Full | 45.70 | 47.80  | PASS |
| N41 | 50MHz  | 30KHz | TM5 | 518598 | Outer Full | 45.68 | 47.74  | PASS |
| N41 | 50MHz  | 30KHz | TM6 | 518598 | Outer Full | 47.51 | 50.26  | PASS |
| N41 | 50MHz  | 30KHz | TM7 | 518598 | Outer Full | 47.47 | 49.60  | PASS |
| N41 | 50MHz  | 30KHz | TM8 | 518598 | Outer Full | 47.48 | 49.56  | PASS |
| N41 | 50MHz  | 30KHz | TM9 | 518598 | Outer Full | 47.40 | 49.62  | PASS |
| N41 | 60MHz  | 30KHz | TM1 | 518598 | Outer Full | 57.96 | 59.84  | PASS |
| N41 | 60MHz  | 30KHz | TM2 | 518598 | Outer Full | 57.96 | 59.87  | PASS |
| N41 | 60MHz  | 30KHz | TM3 | 518598 | Outer Full | 57.85 | 59.97  | PASS |
| N41 | 60MHz  | 30KHz | TM4 | 518598 | Outer Full | 57.81 | 59.84  | PASS |
| N41 | 60MHz  | 30KHz | TM5 | 518598 | Outer Full | 57.83 | 59.89  | PASS |
| N41 | 60MHz  | 30KHz | TM6 | 518598 | Outer Full | 57.94 | 60.01  | PASS |
| N41 | 60MHz  | 30KHz | TM7 | 518598 | Outer Full | 57.82 | 61.59  | PASS |
| N41 | 60MHz  | 30KHz | TM8 | 518598 | Outer Full | 57.73 | 59.87  | PASS |
| N41 | 60MHz  | 30KHz | TM9 | 518598 | Outer Full | 57.82 | 59.85  | PASS |
| N41 | 80MHz  | 30KHz | TM1 | 518598 | Outer Full | 77.18 | 79.79  | PASS |
| N41 | 80MHz  | 30KHz | TM2 | 518598 | Outer Full | 77.30 | 79.77  | PASS |
| N41 | 80MHz  | 30KHz | TM3 | 518598 | Outer Full | 77.22 | 80.20  | PASS |
| N41 | 80MHz  | 30KHz | TM4 | 518598 | Outer Full | 77.18 | 79.65  | PASS |
| N41 | 80MHz  | 30KHz | TM5 | 518598 | Outer Full | 77.17 | 79.86  | PASS |
| N41 | 80MHz  | 30KHz | TM6 | 518598 | Outer Full | 77.48 | 79.97  | PASS |
| N41 | 80MHz  | 30KHz | TM7 | 518598 | Outer Full | 77.48 | 80.11  | PASS |
| N41 | 80MHz  | 30KHz | TM8 | 518598 | Outer Full | 77.60 | 80.22  | PASS |
| N41 | 80MHz  | 30KHz | TM9 | 518598 | Outer Full | 77.52 | 79.98  | PASS |
| N41 | 90MHz  | 30KHz | TM1 | 518598 | Outer Full | 86.62 | 89.48  | PASS |
| N41 | 90MHz  | 30KHz | TM2 | 518598 | Outer Full | 86.79 | 89.66  | PASS |
| N41 | 90MHz  | 30KHz | TM3 | 518598 | Outer Full | 86.86 | 90.69  | PASS |
| N41 | 90MHz  | 30KHz | TM4 | 518598 | Outer Full | 86.67 | 89.69  | PASS |
| N41 | 90MHz  | 30KHz | TM5 | 518598 | Outer Full | 86.61 | 89.61  | PASS |
| N41 | 90MHz  | 30KHz | TM6 | 518598 | Outer Full | 87.49 | 90.56  | PASS |
| N41 | 90MHz  | 30KHz | TM7 | 518598 | Outer Full | 87.42 | 90.34  | PASS |
| N41 | 90MHz  | 30KHz | TM8 | 518598 | Outer Full | 87.37 | 90.28  | PASS |
| N41 | 90MHz  | 30KHz | TM9 | 518598 | Outer Full | 87.41 | 90.35  | PASS |
| N41 | 100MHz | 30KHz | TM1 | 518598 | Outer Full | 96.32 | 99.62  | PASS |
| N41 | 100MHz | 30KHz | TM2 | 518598 | Outer Full | 96.43 | 99.53  | PASS |
| N41 | 100MHz | 30KHz | TM3 | 518598 | Outer Full | 96.31 | 99.50  | PASS |
| N41 | 100MHz | 30KHz | TM4 | 518598 | Outer Full | 96.29 | 99.63  | PASS |
| N41 | 100MHz | 30KHz | TM5 | 518598 | Outer Full | 96.21 | 99.60  | PASS |
| N41 | 100MHz | 30KHz | TM6 | 518598 | Outer Full | 97.24 | 100.80 | PASS |
| N41 | 100MHz | 30KHz | TM7 | 518598 | Outer Full | 97.34 | 100.60 | PASS |
| N41 | 100MHz | 30KHz | TM8 | 518598 | Outer Full | 97.30 | 100.60 | PASS |




Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing/inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)


|     |        |       |     |        |            |       |        |      |
|-----|--------|-------|-----|--------|------------|-------|--------|------|
| N41 | 100MHz | 30KHz | TM9 | 518598 | Outer Full | 97.20 | 100.60 | PASS |
|-----|--------|-------|-----|--------|------------|-------|--------|------|

## 4.2 Test Plots

OBW&amp;EBW N41 15KHz TM1 10MHz 518601 Outer Full

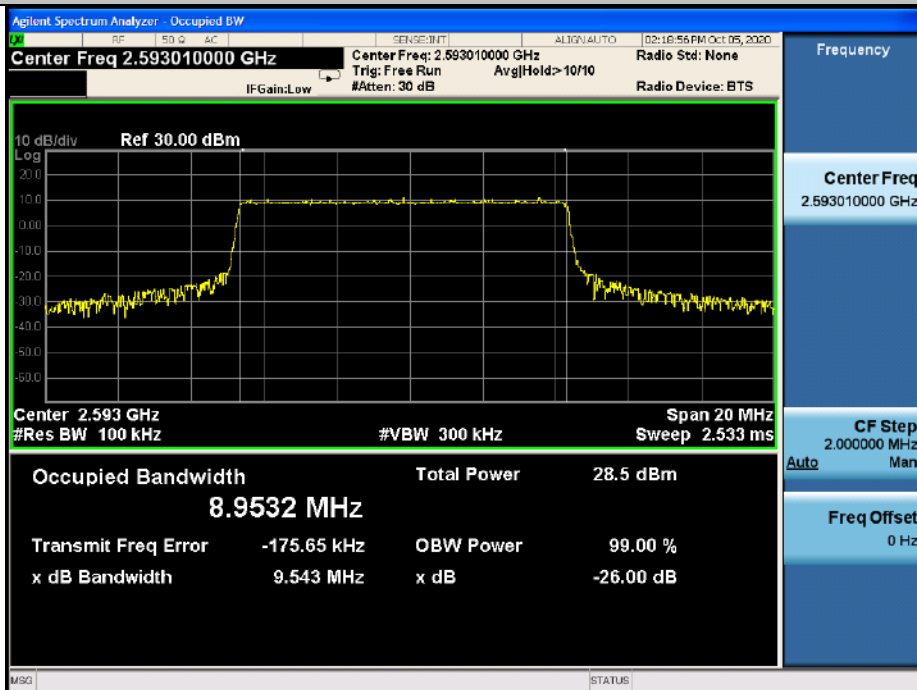

OBW&amp;EBW N41 15KHz TM2 10MHz 518601 Outer Full

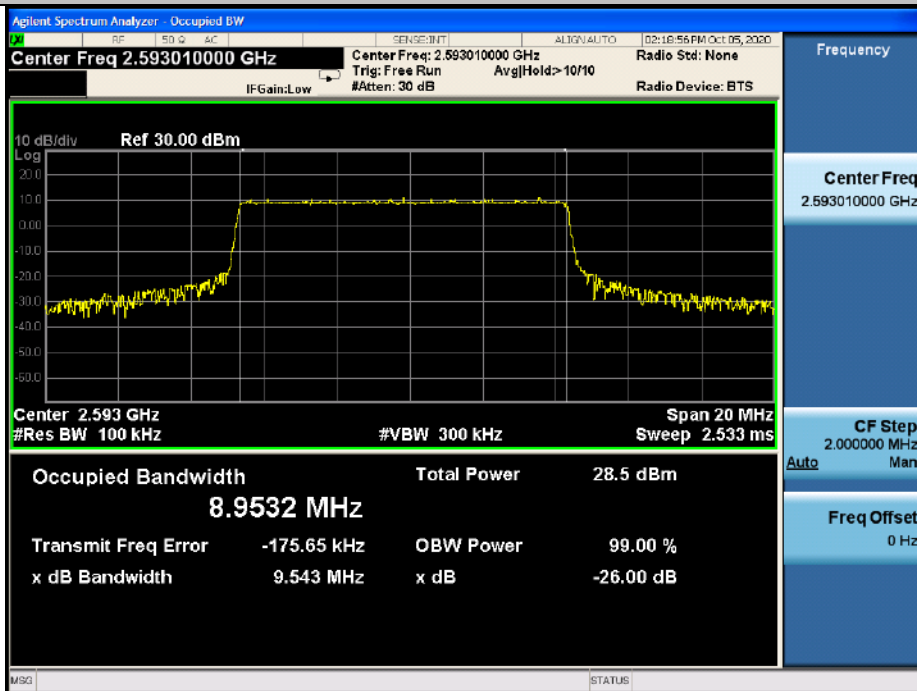



## OBW&EBW N41 15KHz TM3 10MHz 518601 Outer Full



## OBW&EBW N41 15KHz TM4 10MHz 518601 Outer Full




Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&amp;EBW N41 15KHz TM5 10MHz 518601 Outer Full




## OBW&amp;EBW N41 15KHz TM6 10MHz 518601 Outer Full

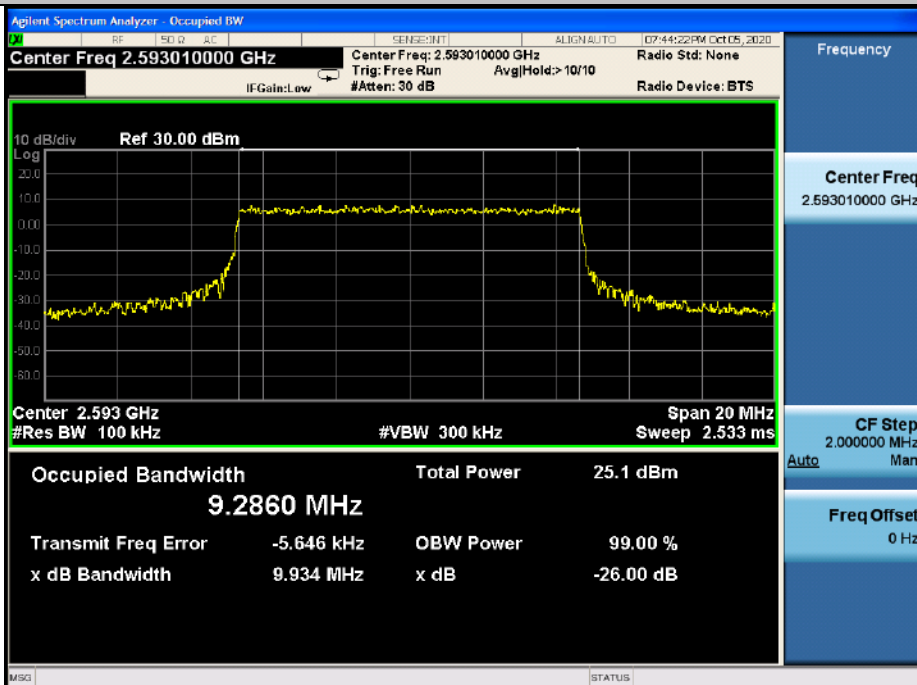

## OBW&EBW N41 15KHz TM7 10MHz 518601 Outer Full



## OBW&EBW N41 15KHz TM8 10MHz 518601 Outer Full

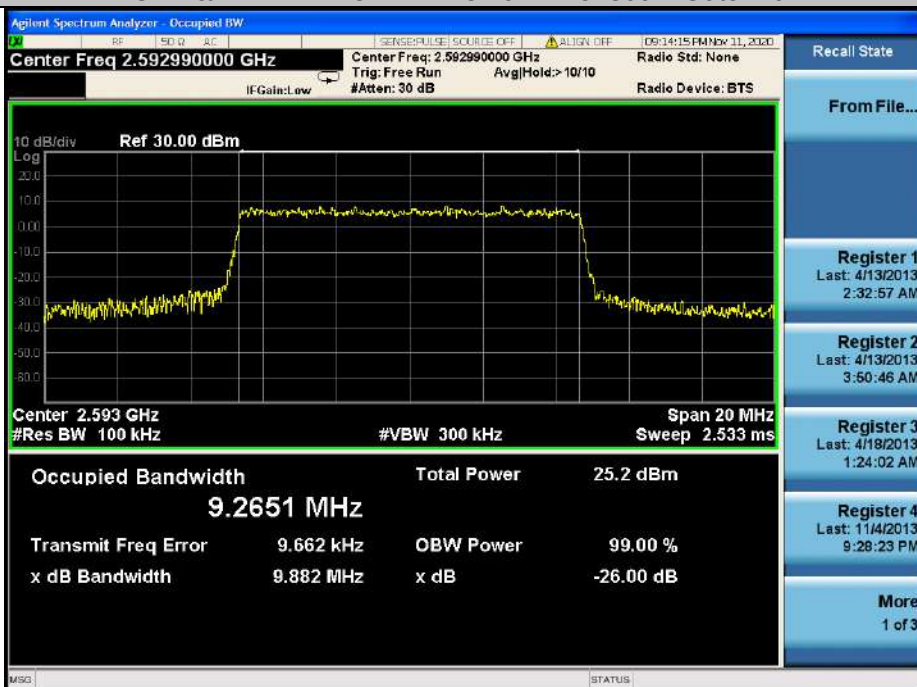


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.


Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



## OBW&EBW N41 15KHz TM9 10MHz 518601 Outer Full

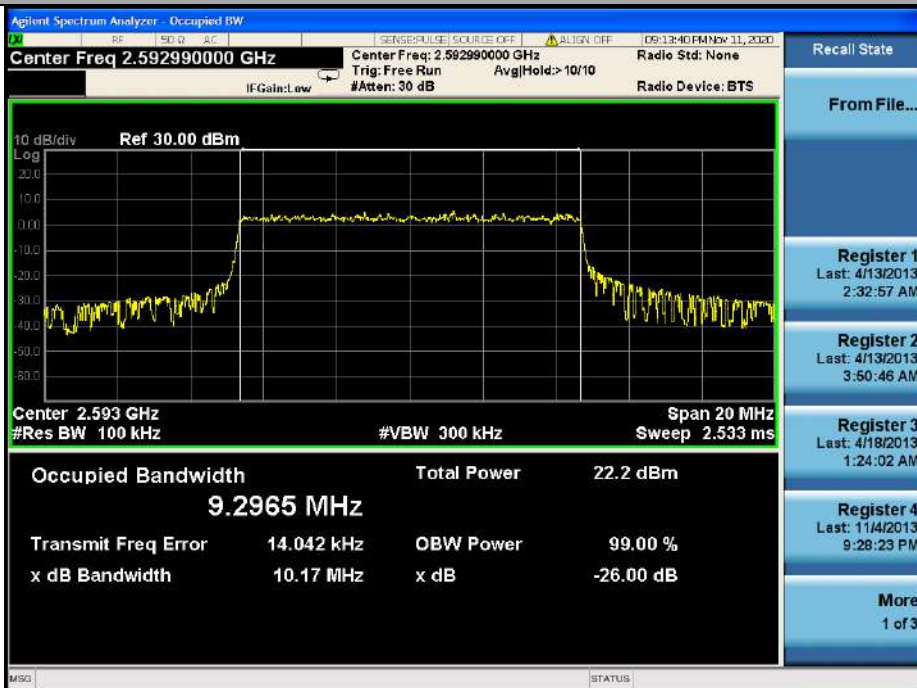


## OBW&EBW N41 15KHz TM1 15MHz 518601 Outer Full

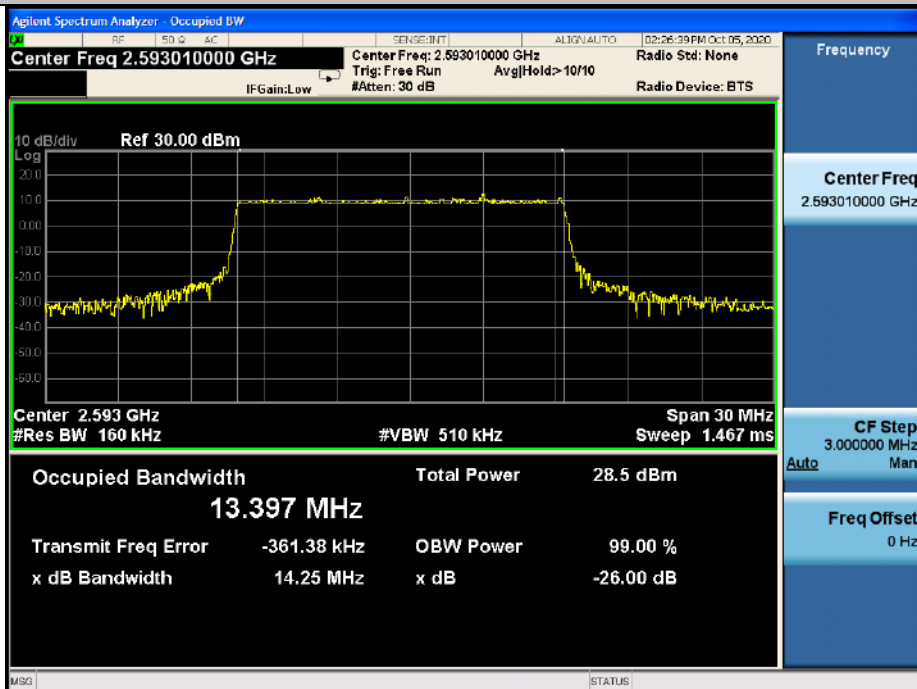


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)


## OBW&EBW N41 15KHz TM2 15MHz 518601 Outer Full

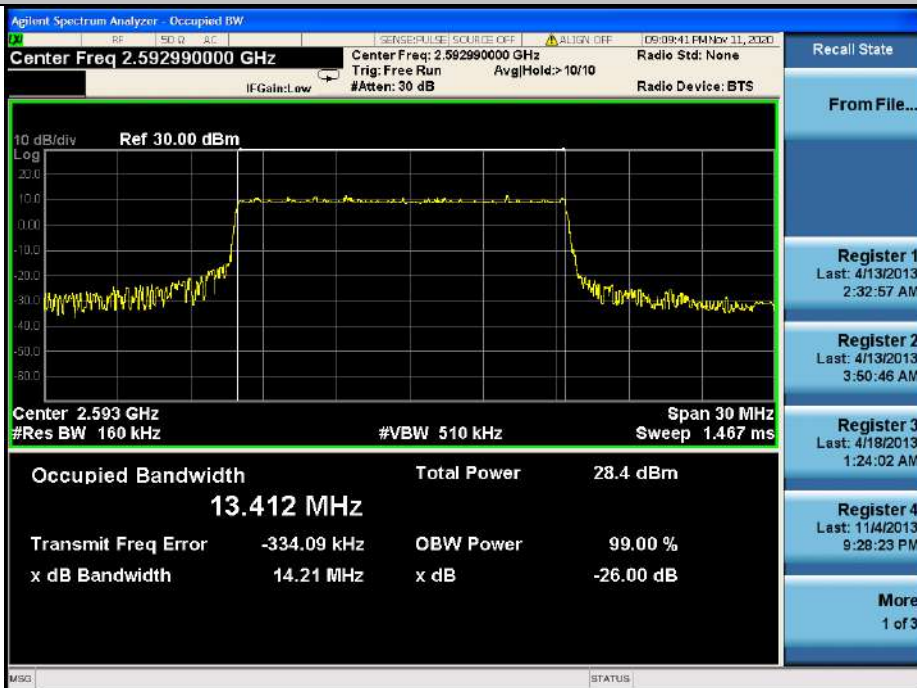


## OBW&EBW N41 15KHz TM3 15MHz 518601 Outer Full

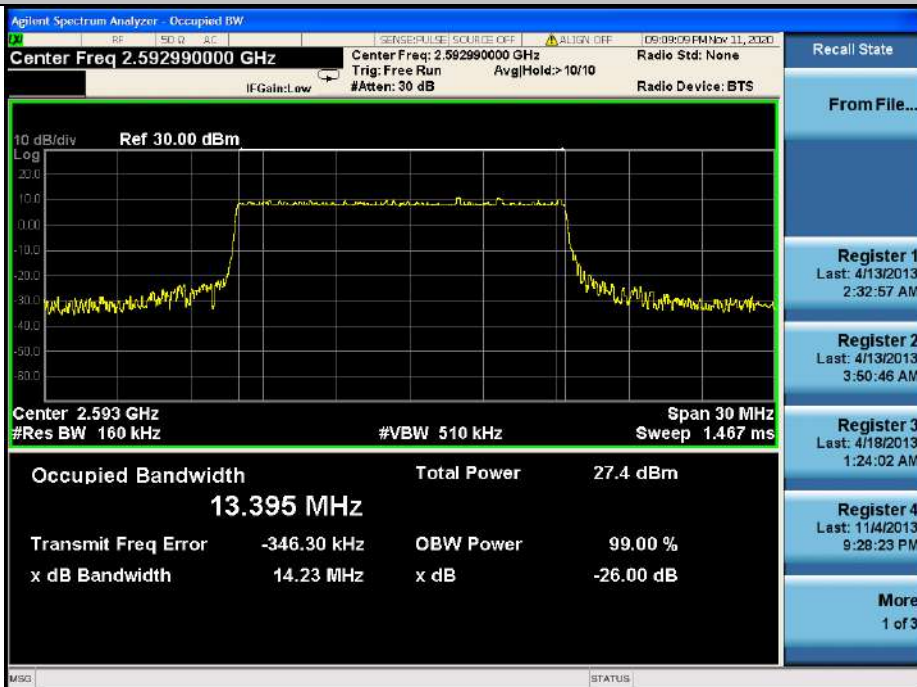

## OBW&EBW N41 15KHz TM4 15MHz 518601 Outer Full

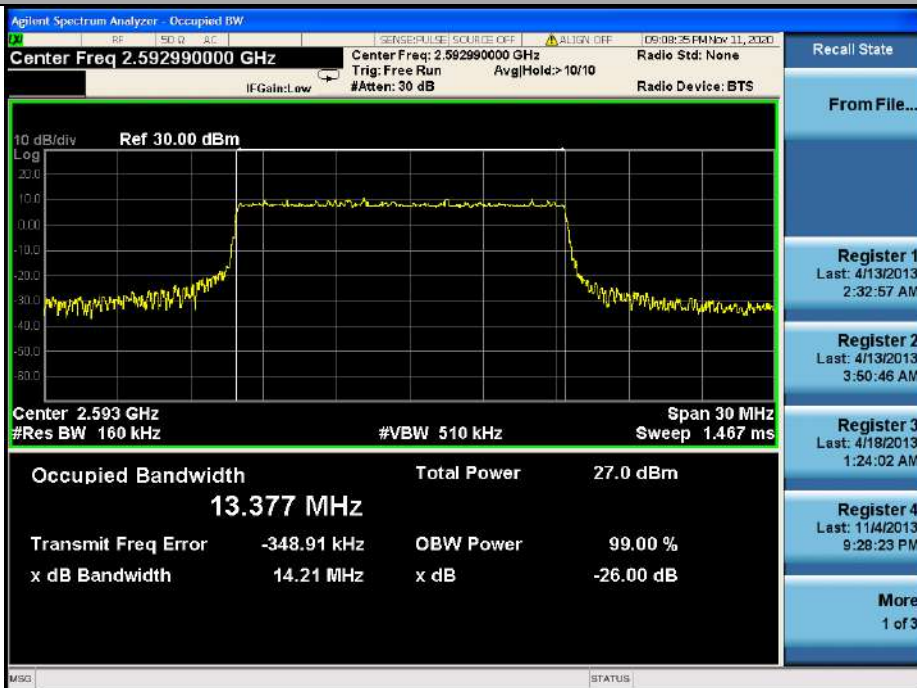

## OBW&EBW N41 15KHz TM5 15MHz 518601 Outer Full

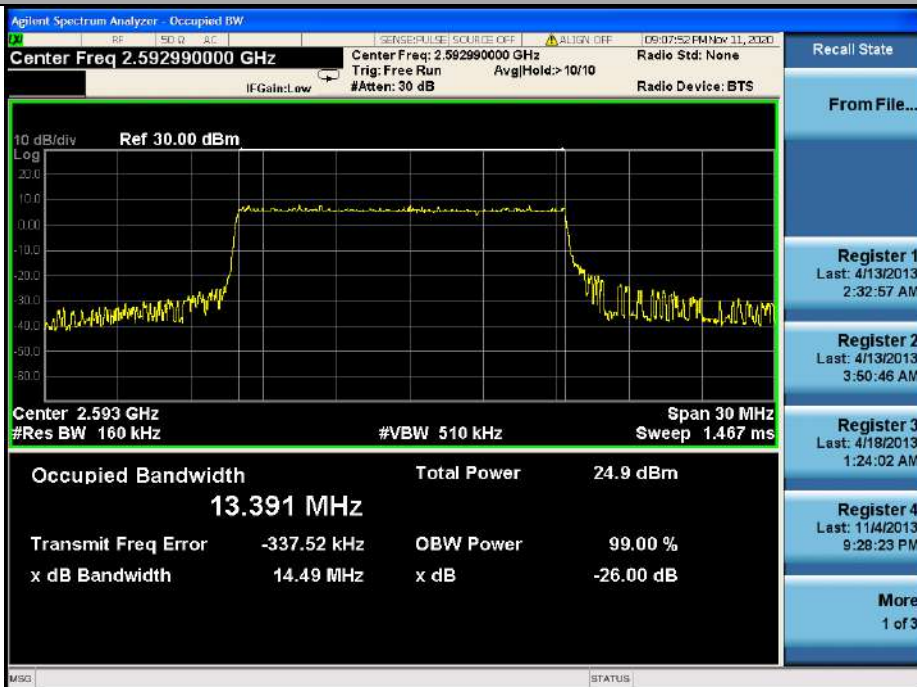


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.


Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)




### OBW&EBW N41 15KHz TM6 15MHz 518601 Outer Full

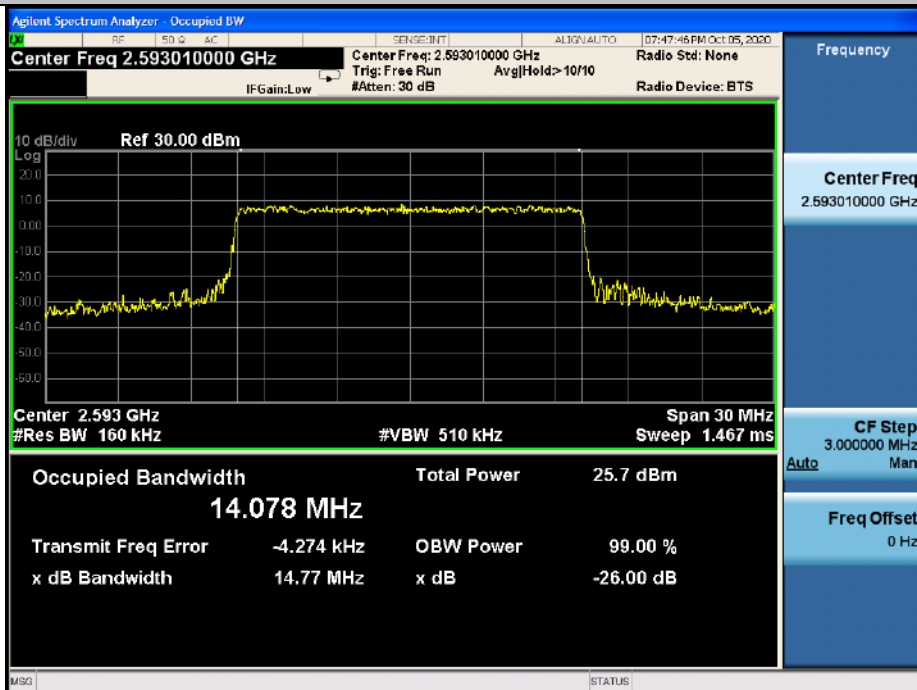


### OBW&EBW N41 15KHz TM7 15MHz 518601 Outer Full

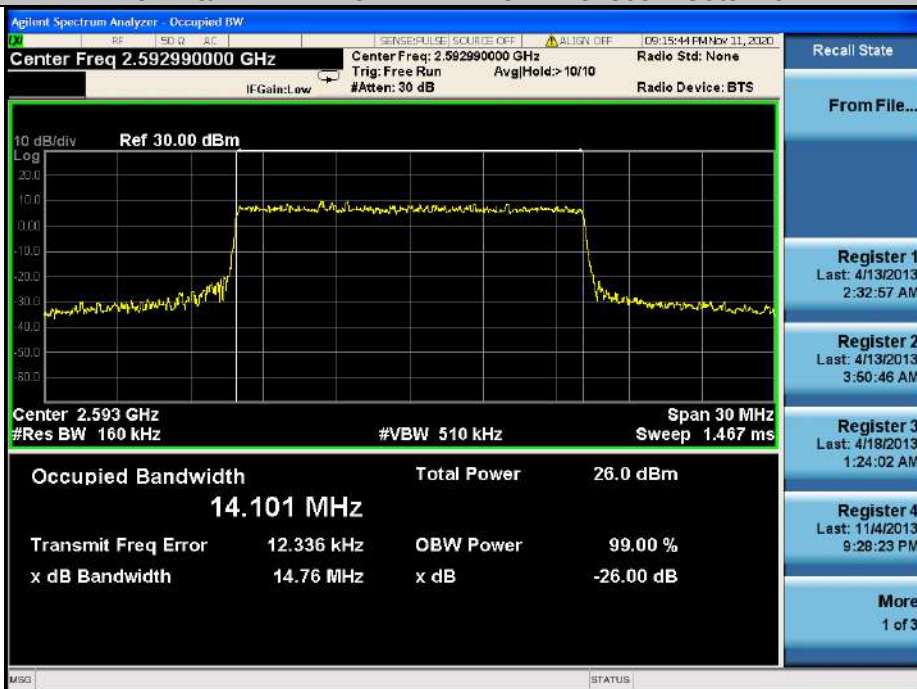


## OBW&amp;EBW N41 15KHz TM8 15MHz 518601 Outer Full

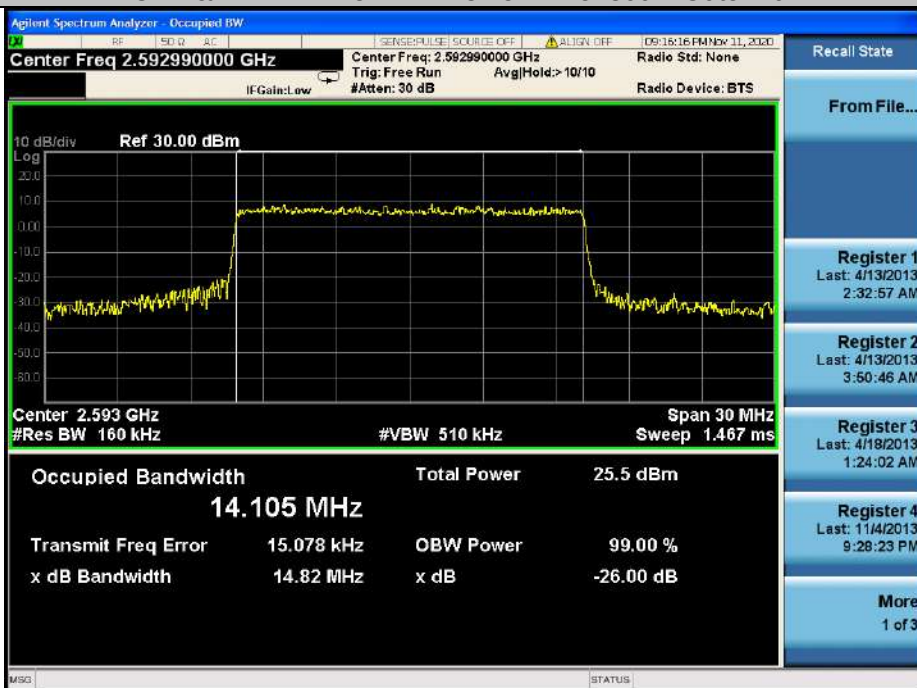


## OBW&amp;EBW N41 15KHz TM9 15MHz 518601 Outer Full

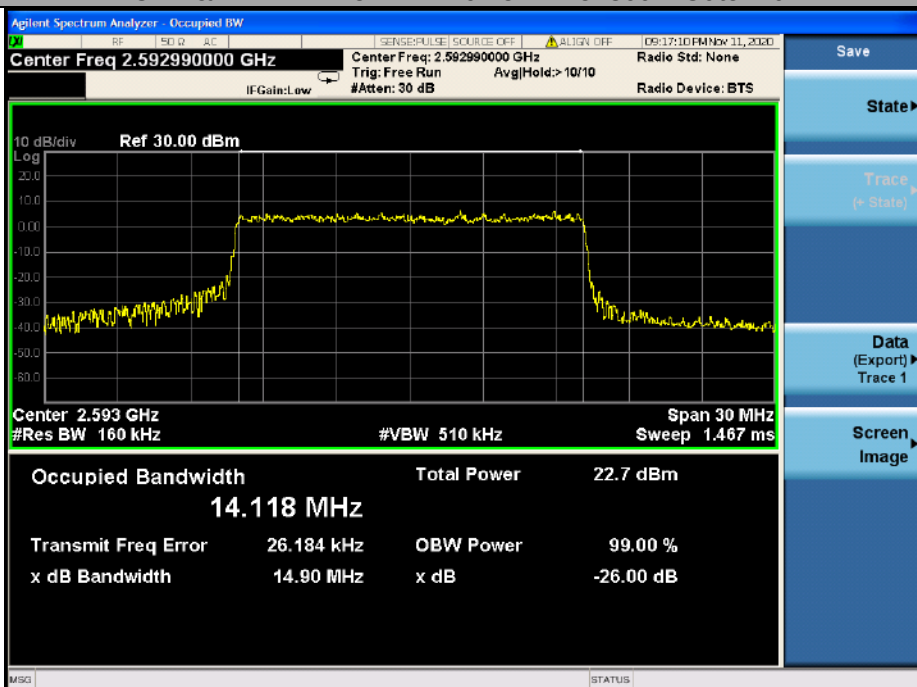

## OBW&amp;EBW N41 15KHz TM1 20MHz 518601 Outer Full

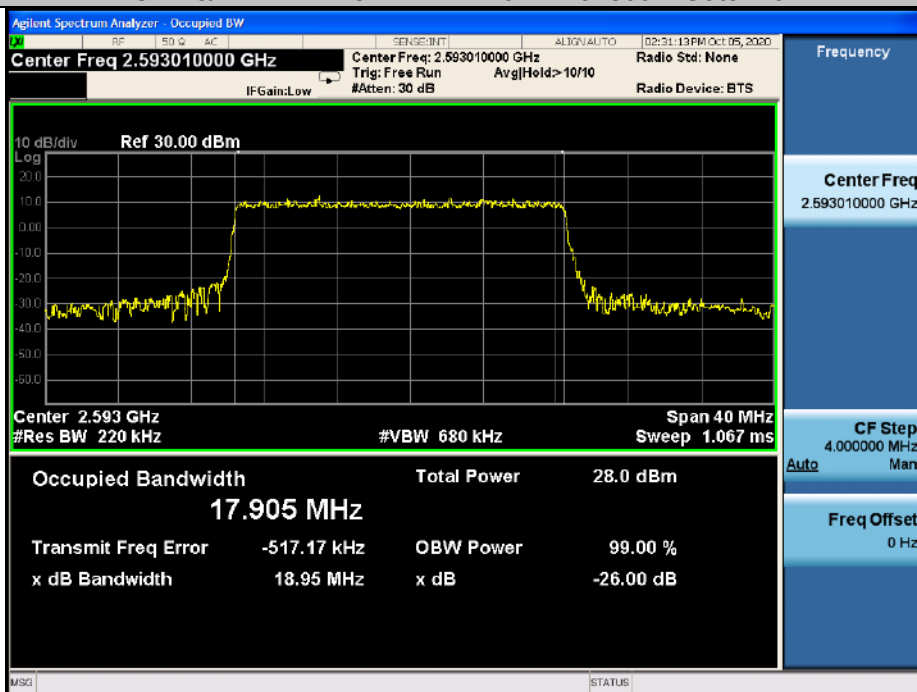


## OBW&amp;EBW N41 15KHz TM2 20MHz 518601 Outer Full

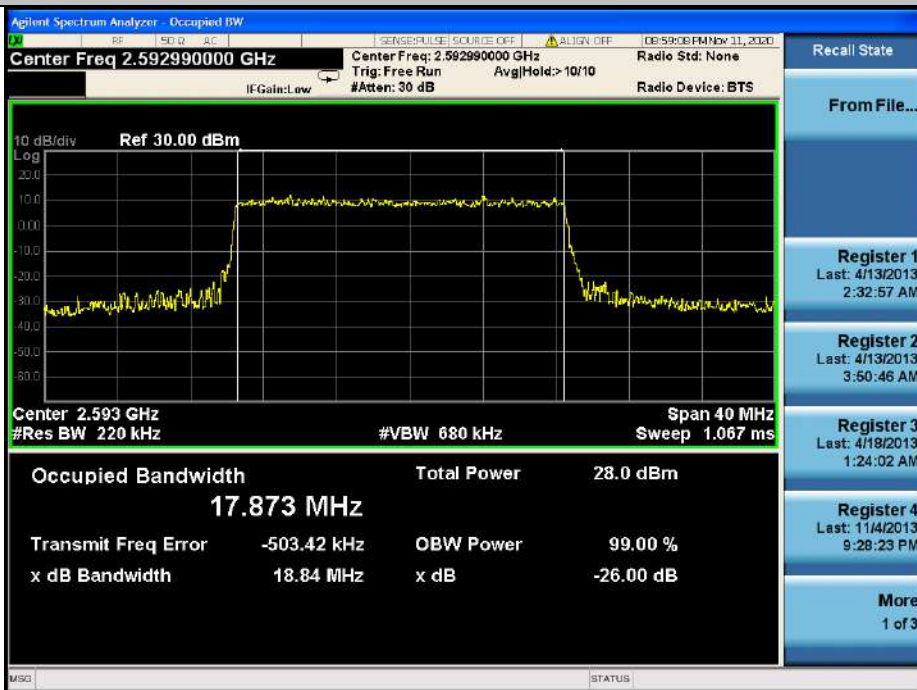



## OBW&EBW N41 15KHz TM3 20MHz 518601 Outer Full

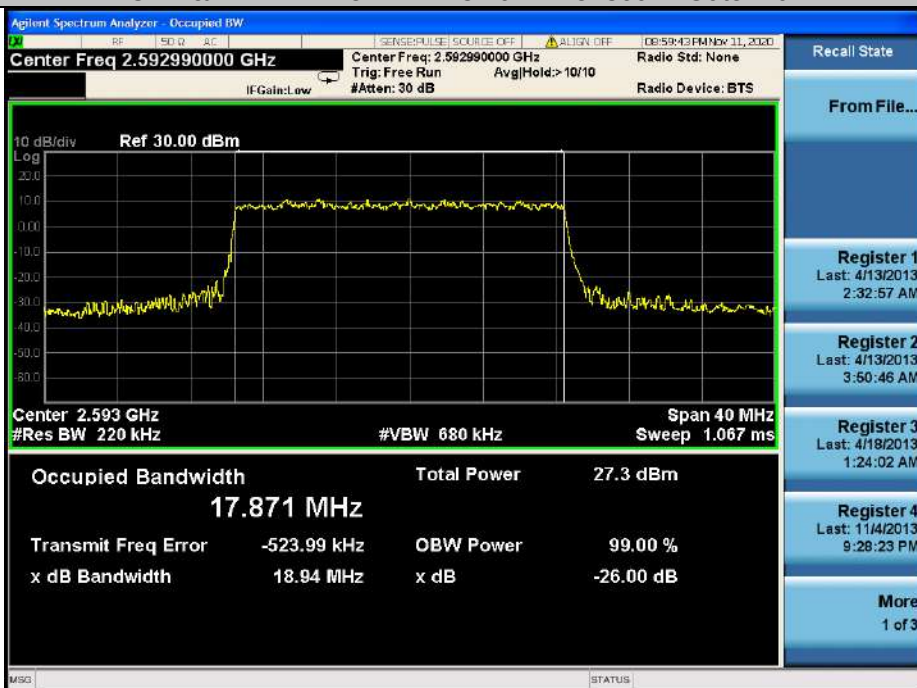


## OBW&EBW N41 15KHz TM4 20MHz 518601 Outer Full




Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&EBW N41 15KHz TM5 20MHz 518601 Outer Full

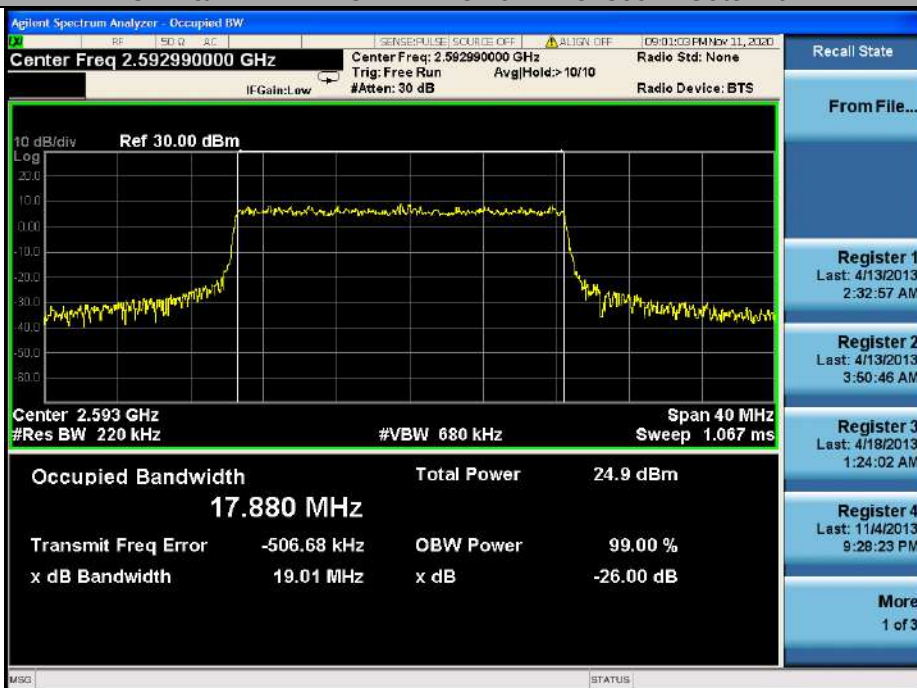


## OBW&EBW N41 15KHz TM6 20MHz 518601 Outer Full

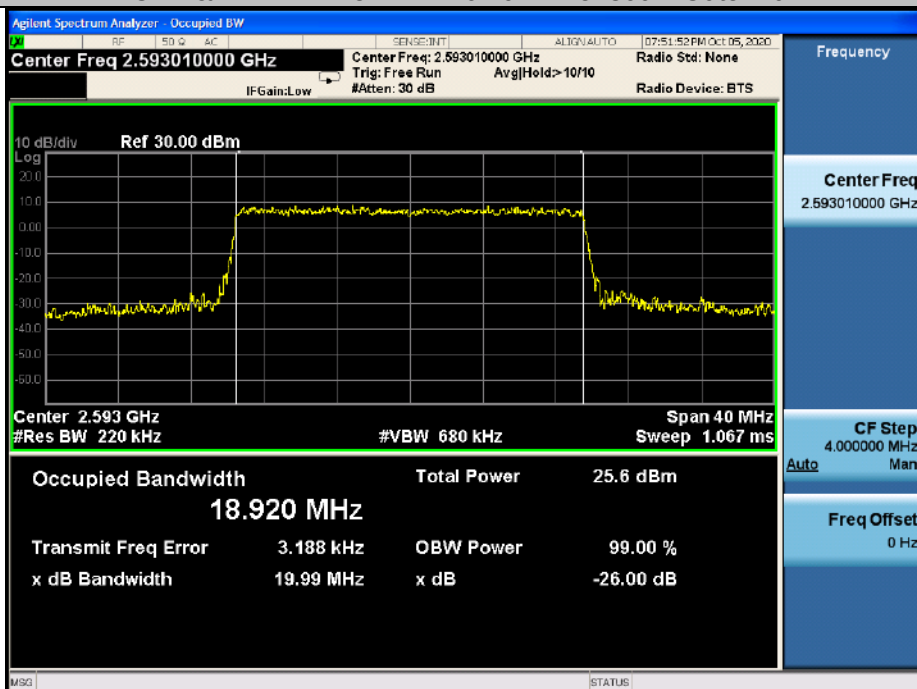


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&EBW N41 15KHz TM7 20MHz 518601 Outer Full

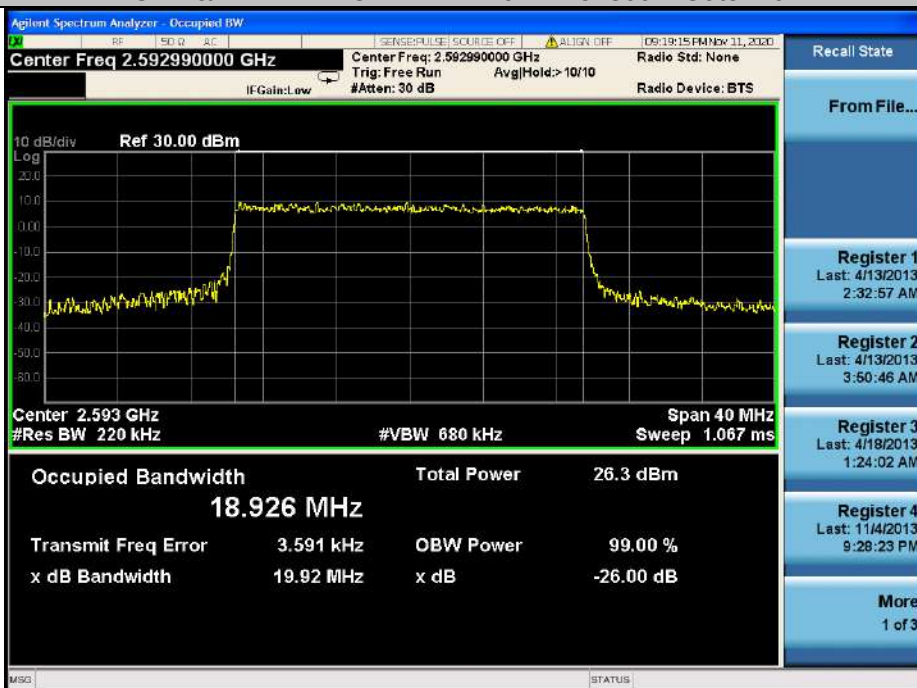


## OBW&EBW N41 15KHz TM8 20MHz 518601 Outer Full

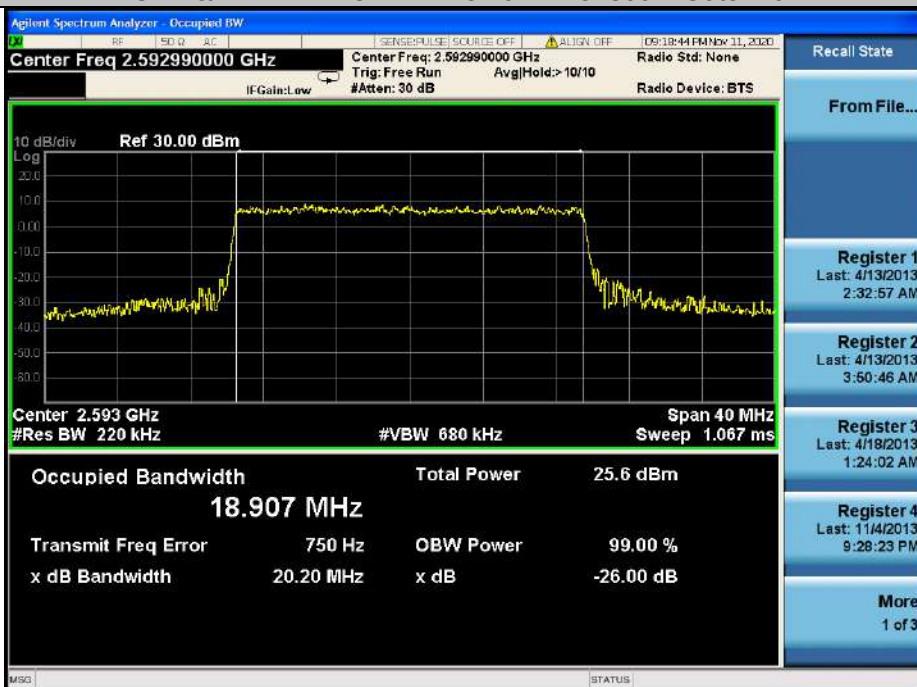




## OBW&EBW N41 15KHz TM9 20MHz 518601 Outer Full

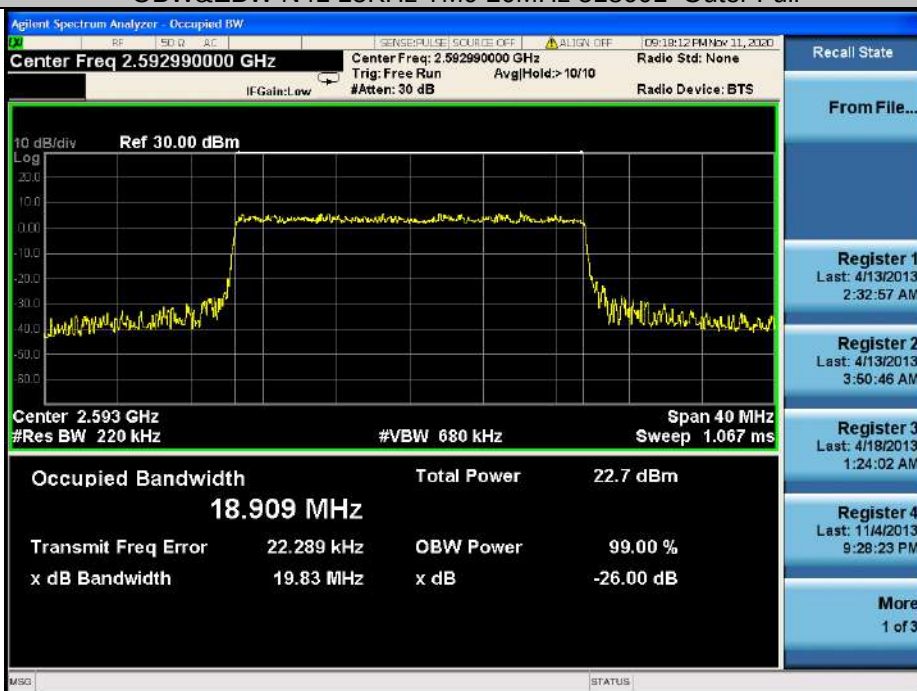


## OBW&EBW N41 15KHz TM1 40MHz 518601 Outer Full

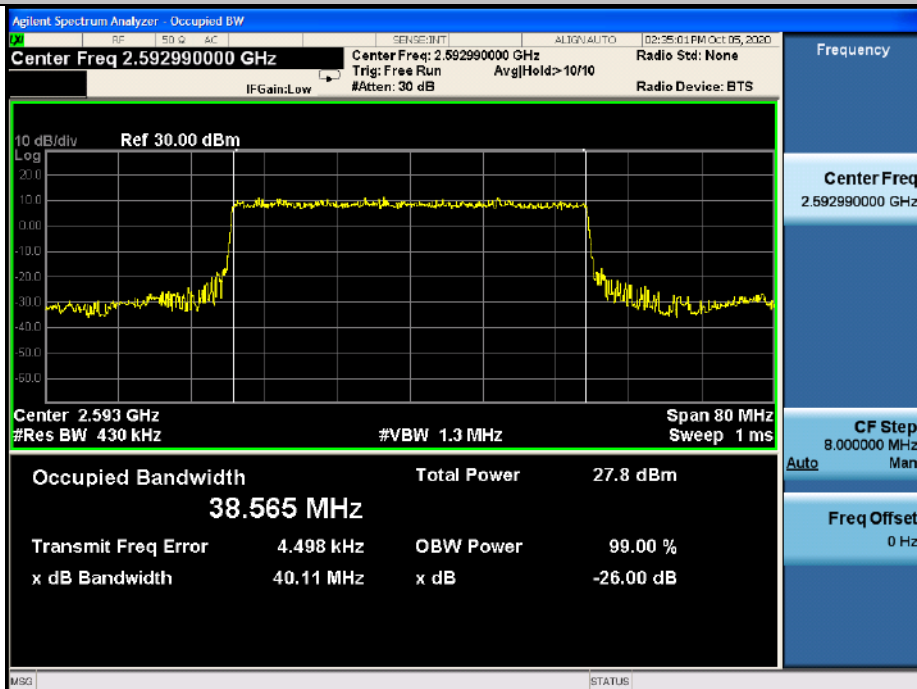


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&EBW N41 15KHz TM2 40MHz 518601 Outer Full

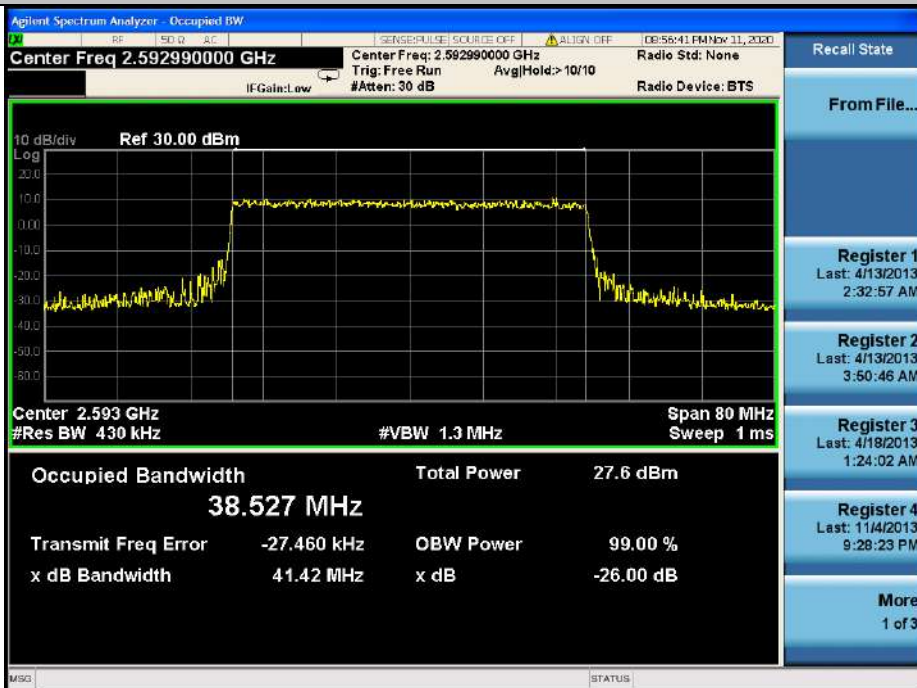


## OBW&EBW N41 15KHz TM3 40MHz 518601 Outer Full

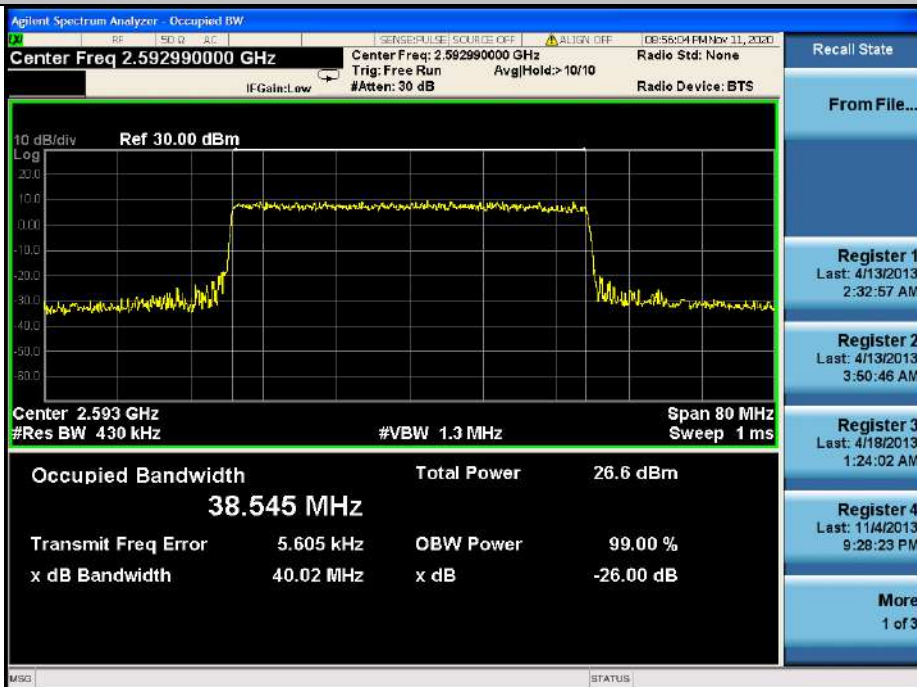


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&EBW N41 15KHz TM4 40MHz 518601 Outer Full

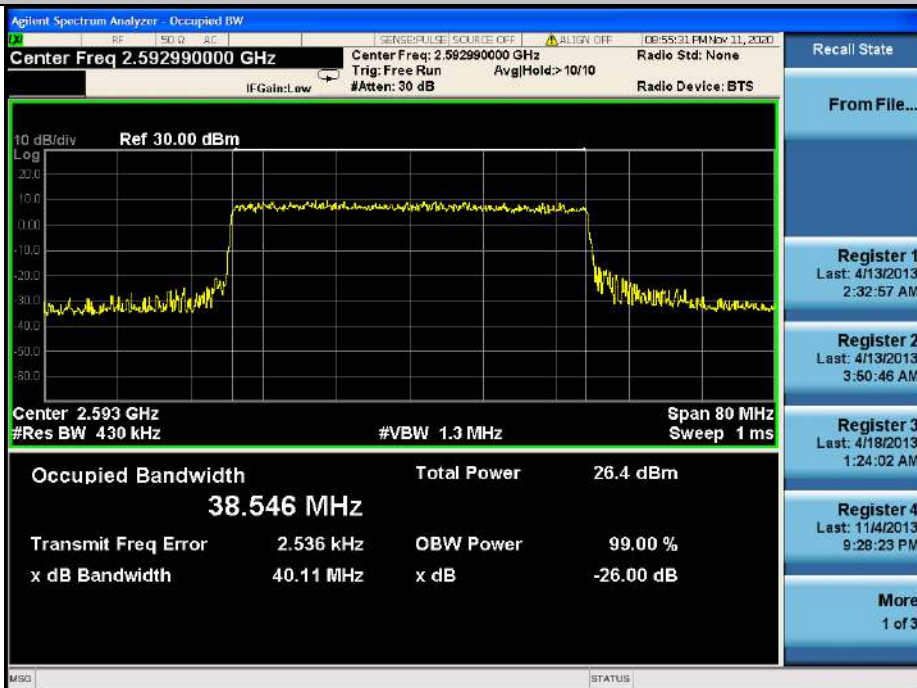

## OBW&EBW N41 15KHz TM5 40MHz 518601 Outer Full

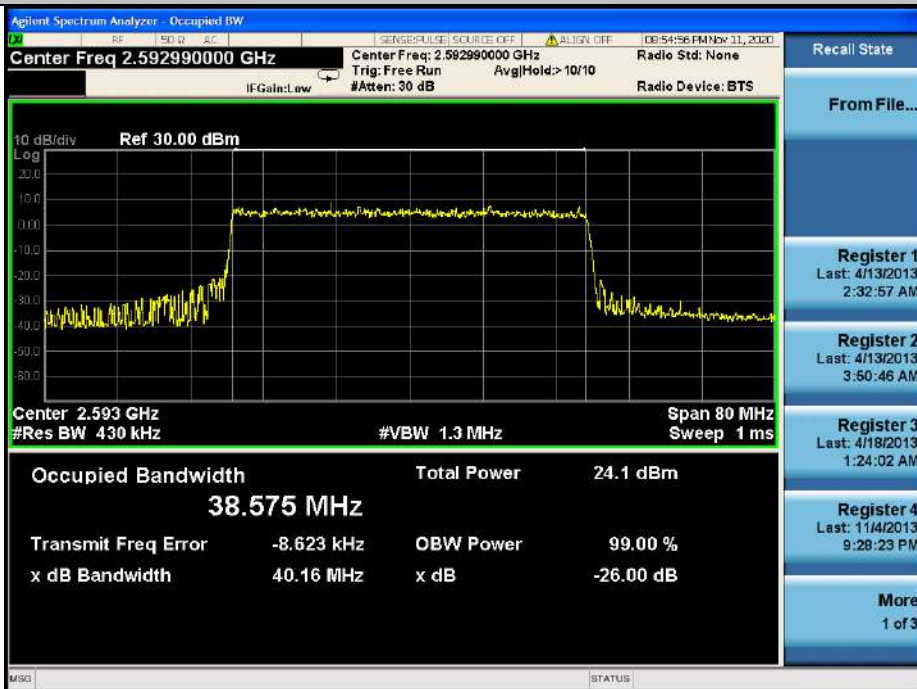

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)




## OBW&EBW N41 15KHz TM6 40MHz 518601 Outer Full




## OBW&EBW N41 15KHz TM7 40MHz 518601 Outer Full



## OBW&EBW N41 15KHz TM8 40MHz 518601 Outer Full

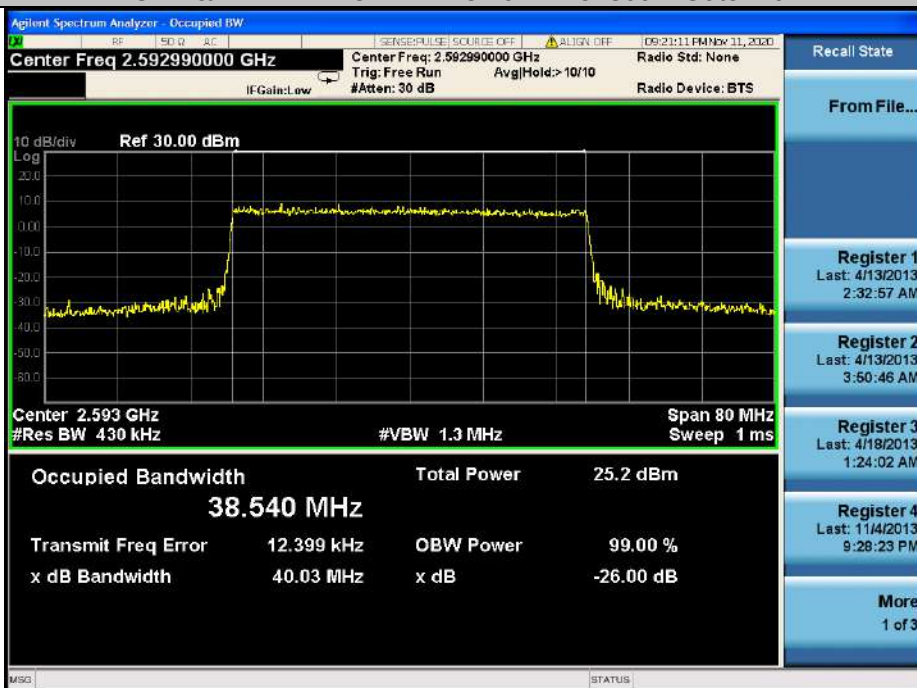


## OBW&EBW N41 15KHz TM9 40MHz 518601 Outer Full

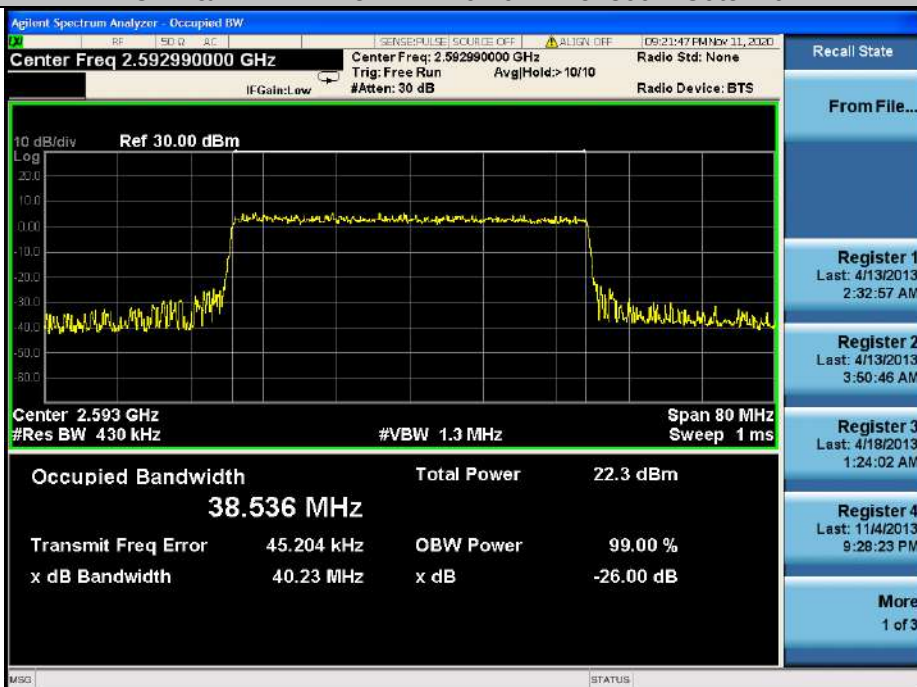


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&amp;EBW N41 15KHz TM1 50MHz 518601 Outer Full

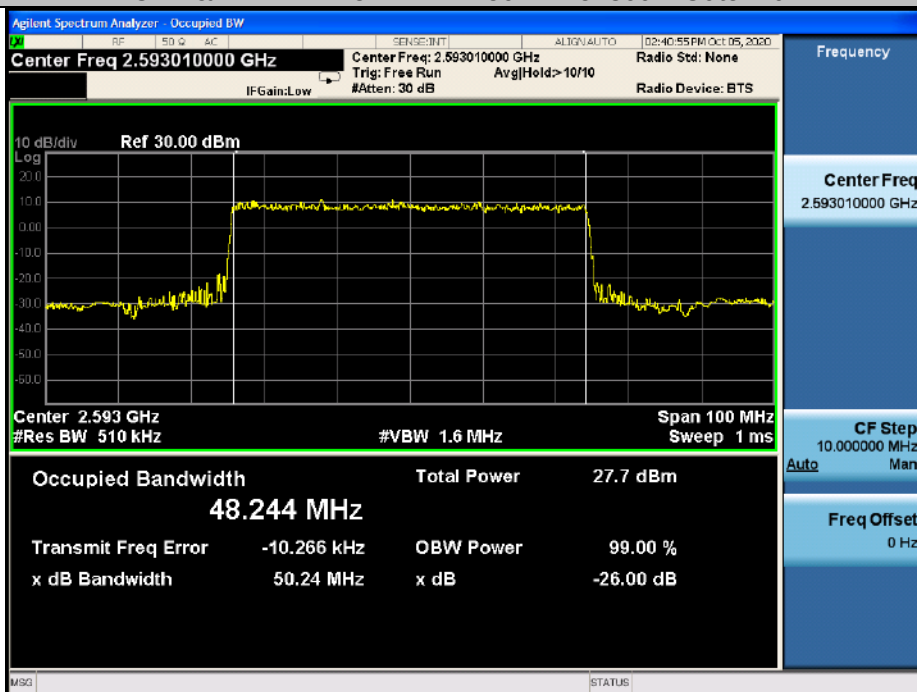

## OBW&amp;EBW N41 15KHz TM2 50MHz 518601 Outer Full

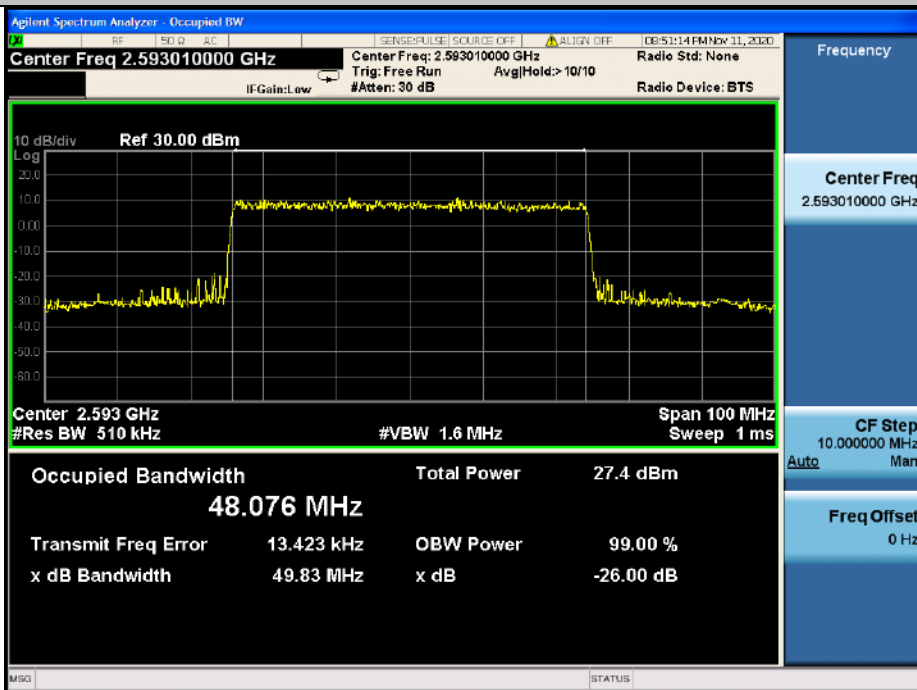


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.


Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)




## OBW&amp;EBW N41 15KHz TM3 50MHz 518601 Outer Full

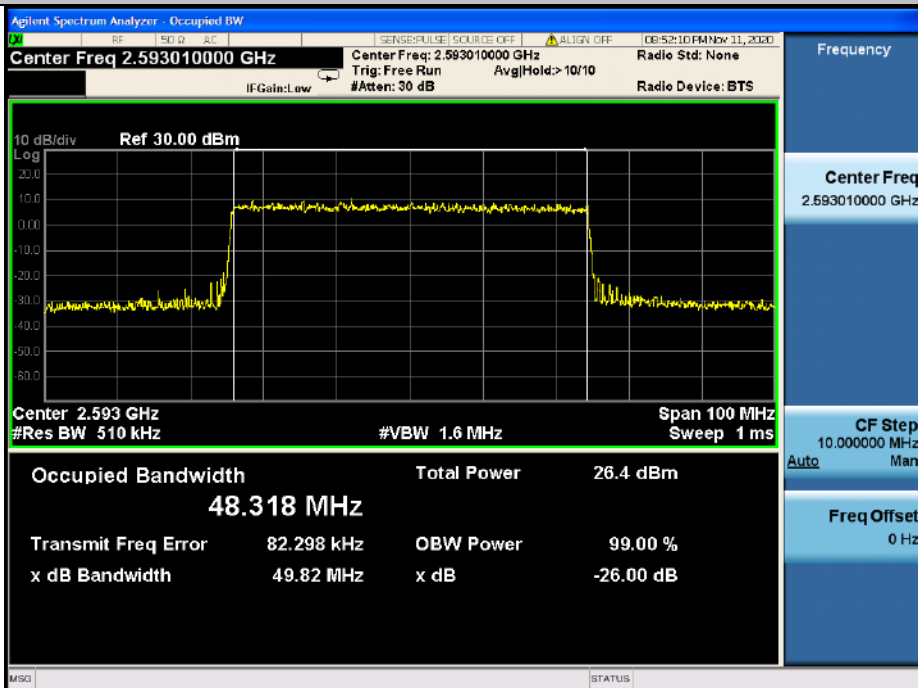


## OBW&amp;EBW N41 15KHz TM4 50MHz 518601 Outer Full

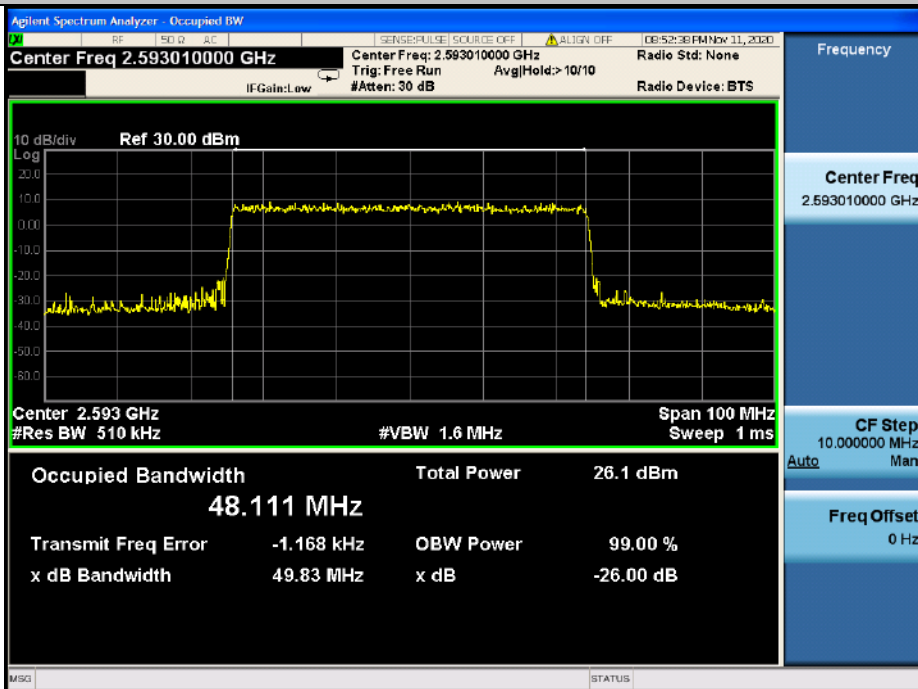


## OBW&amp;EBW N41 15KHz TM5 50MHz 518601 Outer Full

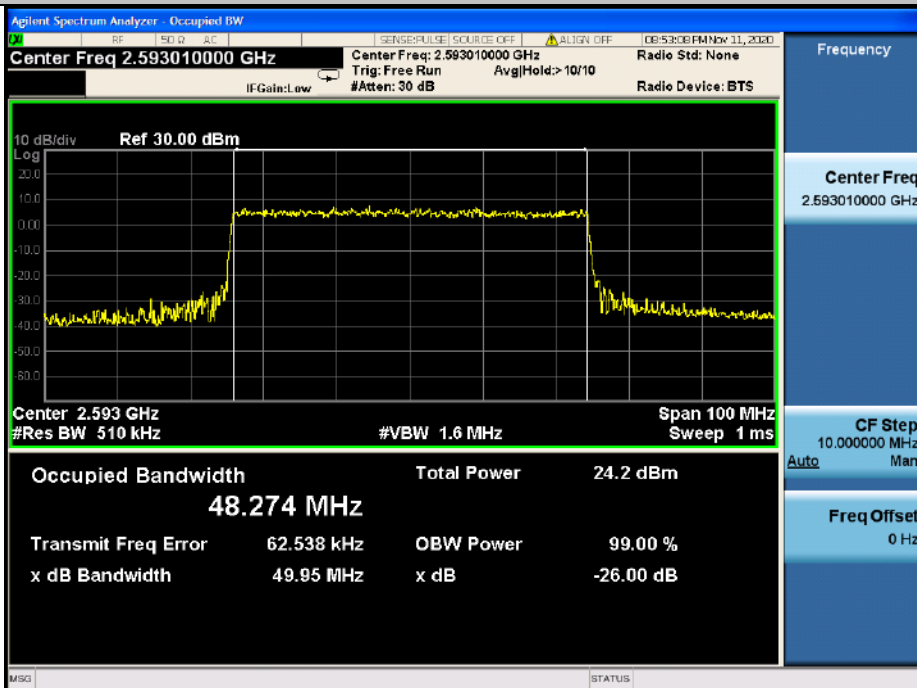

## OBW&amp;EBW N41 15KHz TM6 50MHz 518601 Outer Full

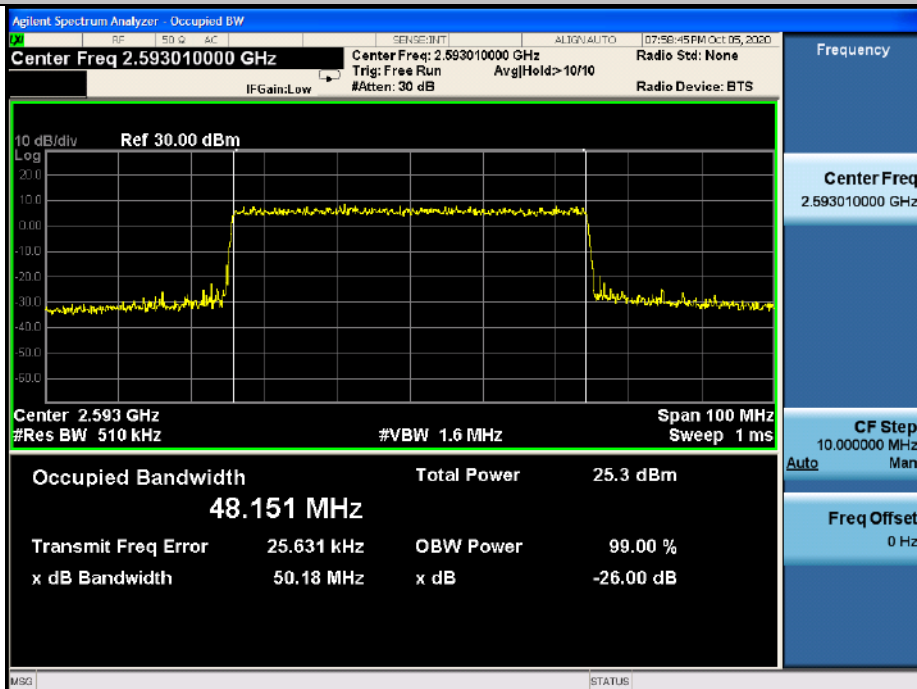

## OBW&EBW N41 15KHz TM7 50MHz 518601 Outer Full

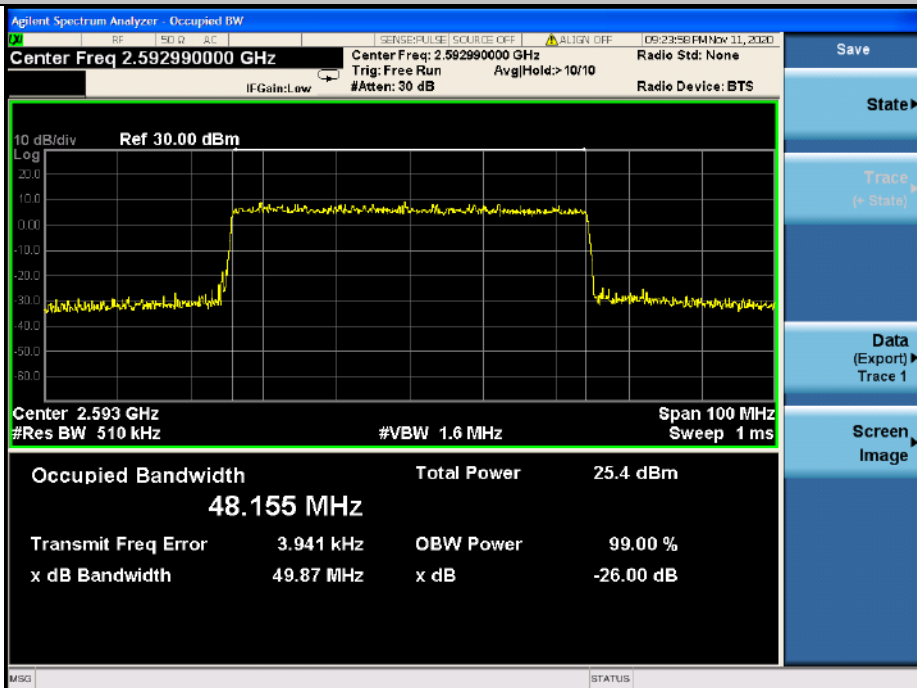

## OBW&EBW N41 15KHz TM8 50MHz 518601 Outer Full




Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.


Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



## OBW&EBW N41 15KHz TM9 50MHz 518601 Outer Full

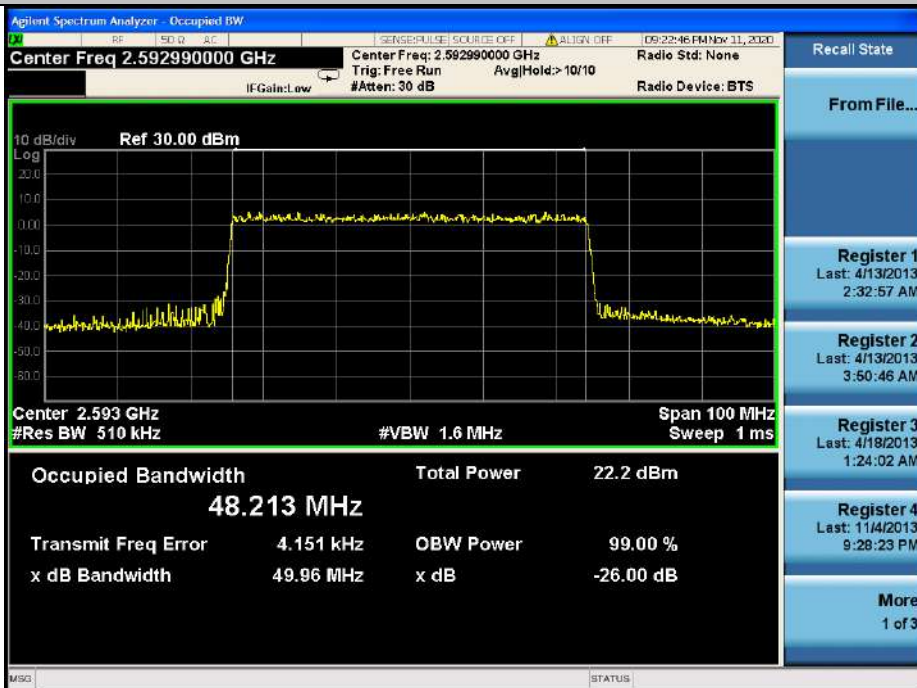


## OBW&EBW N41 30KHz TM1 10MHz 518598 Outer Full

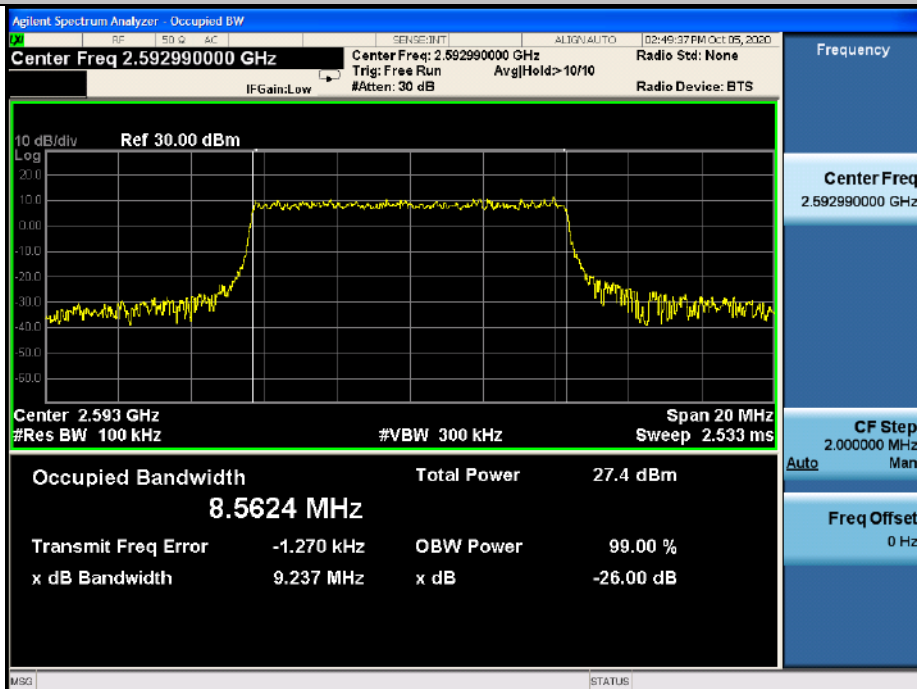


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)


## OBW&EBW N41 30KHz TM2 10MHz 518598 Outer Full

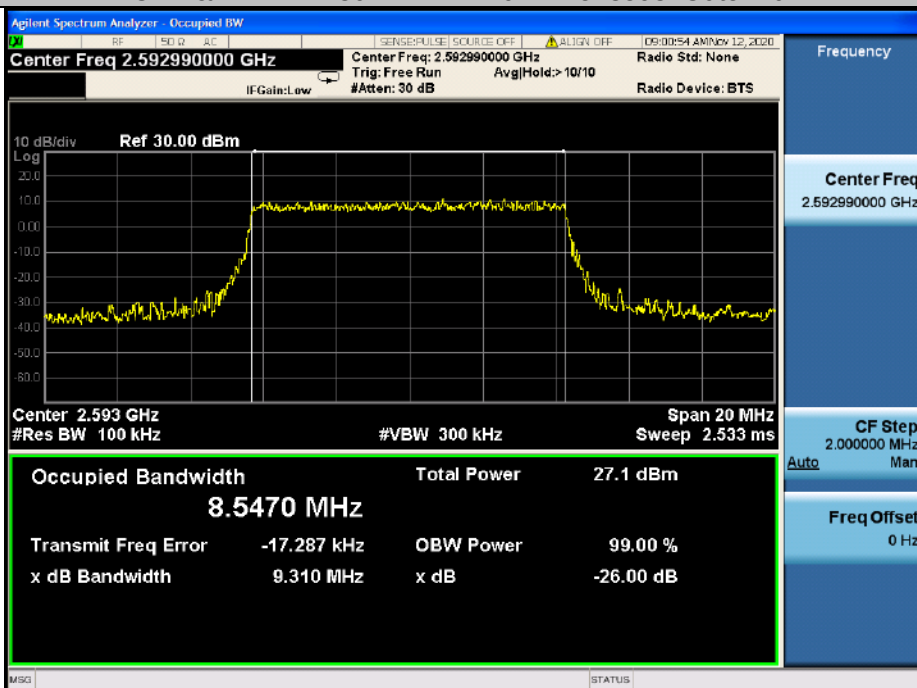


## OBW&EBW N41 30KHz TM3 10MHz 518598 Outer Full

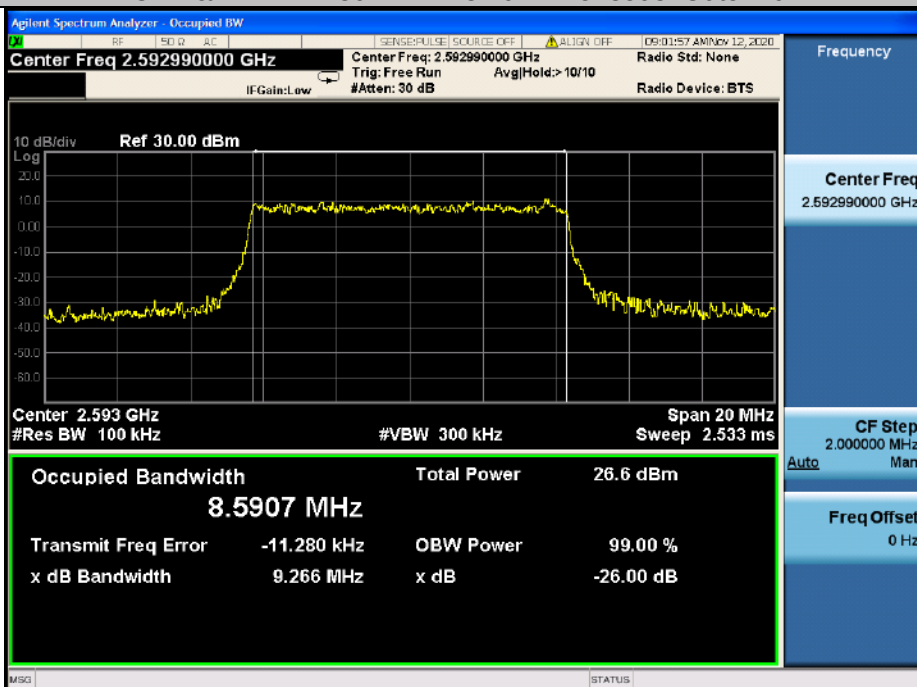

## OBW&amp;EBW N41 30KHz TM4 10MHz 518598 Outer Full

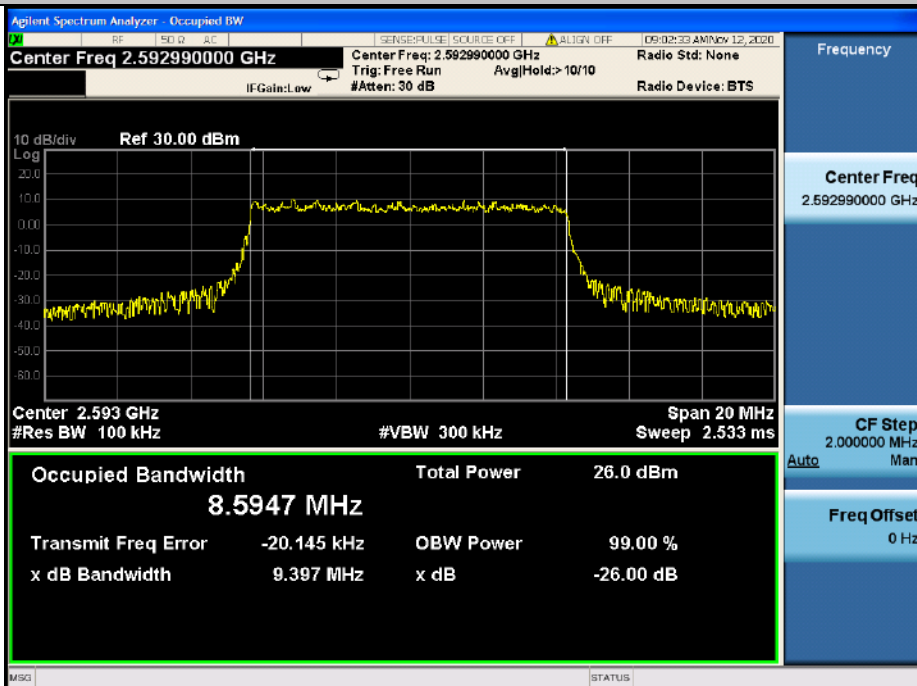


## OBW&amp;EBW N41 30KHz TM5 10MHz 518598 Outer Full

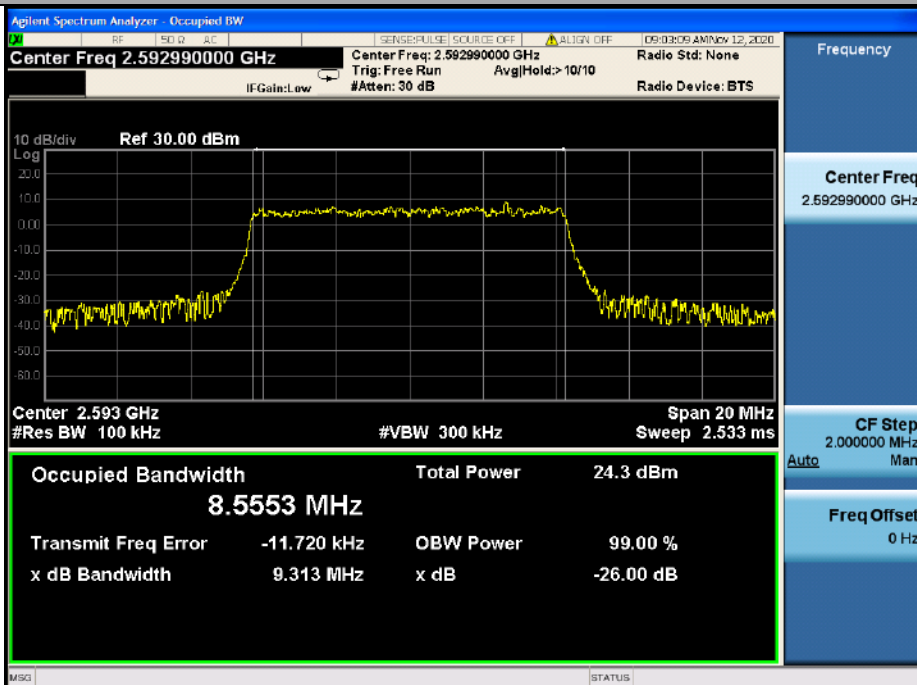




## OBW&amp;EBW N41 30KHz TM6 10MHz 518598 Outer Full

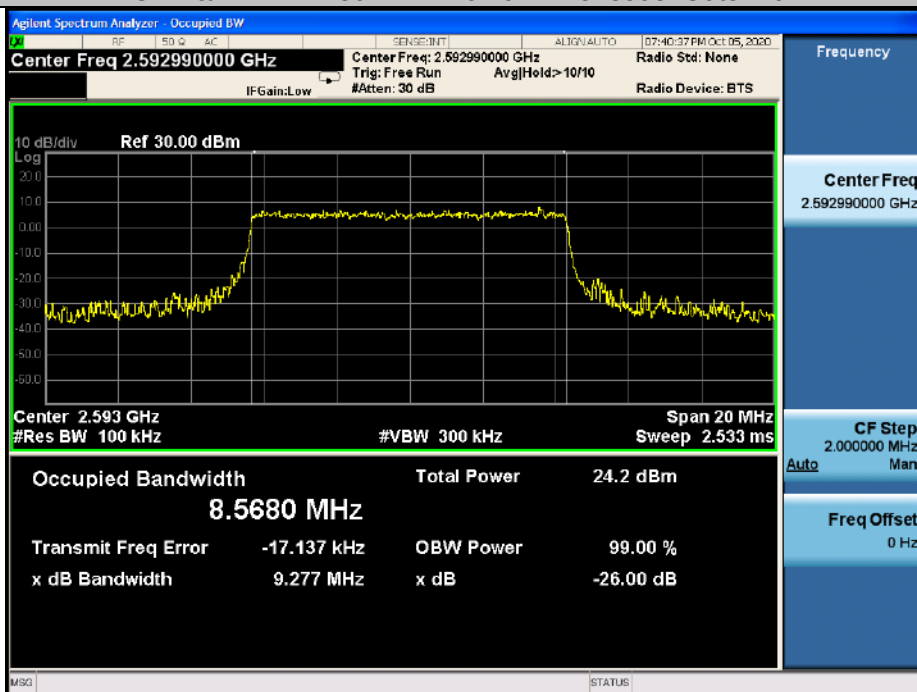


## OBW&amp;EBW N41 30KHz TM7 10MHz 518598 Outer Full



## OBW&EBW N41 30KHz TM8 10MHz 518598 Outer Full

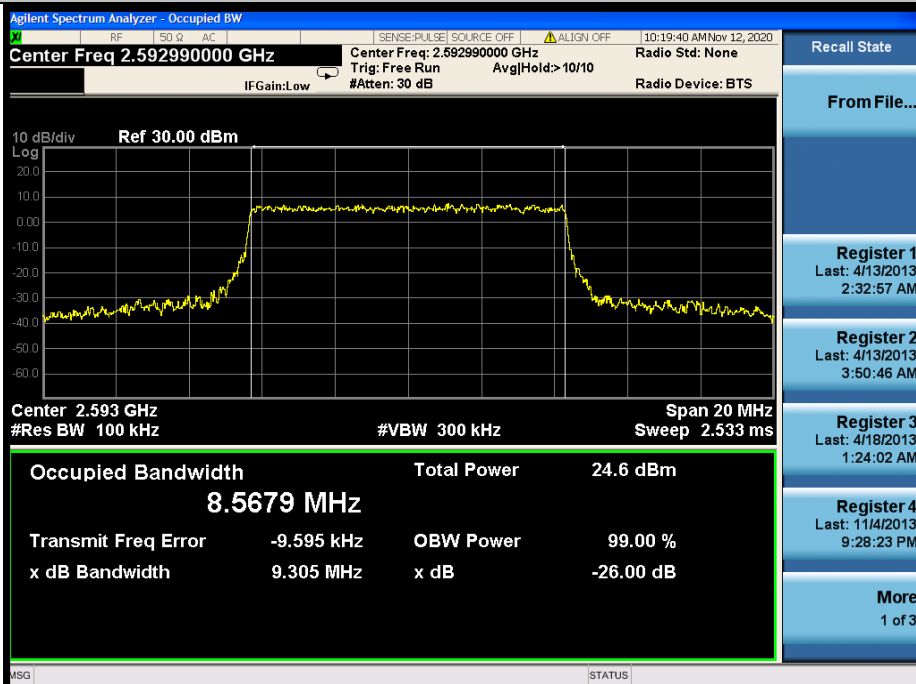


## OBW&EBW N41 30KHz TM9 10MHz 518598 Outer Full

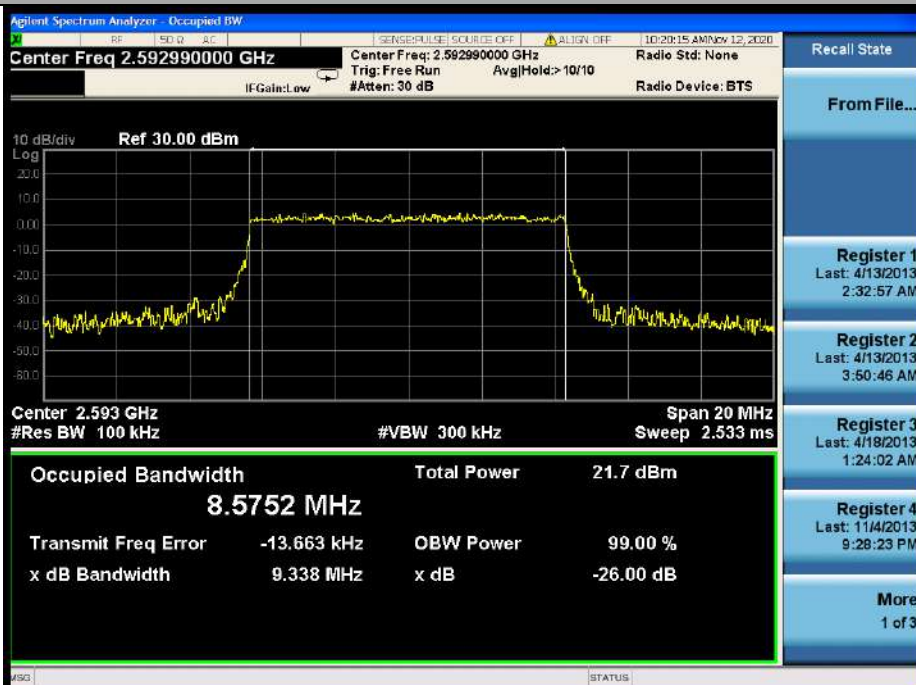


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&EBW N41 30KHz TM1 15MHz 518598 Outer Full

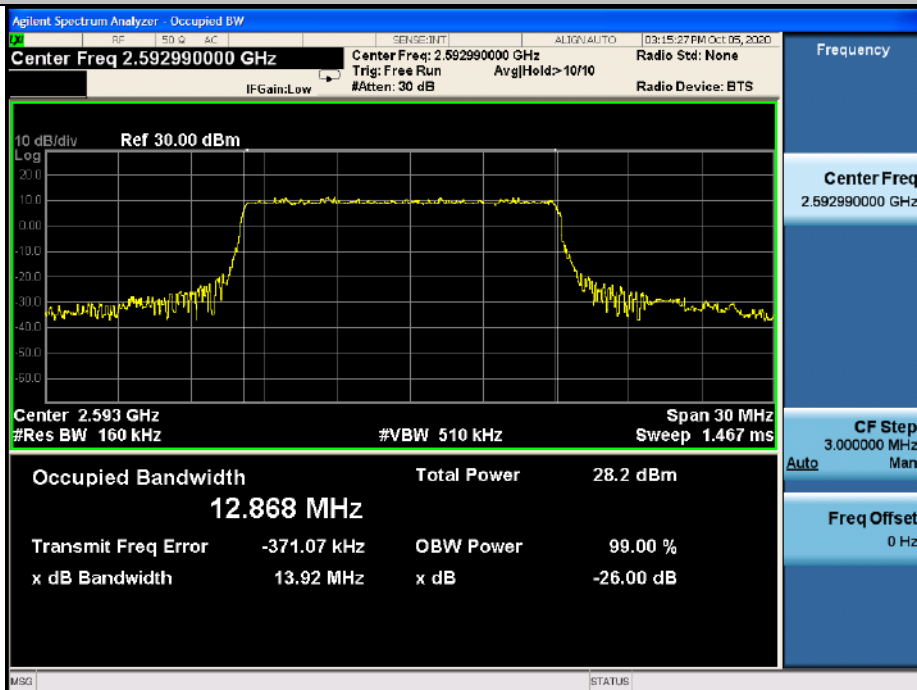


## OBW&EBW N41 30KHz TM2 15MHz 518598 Outer Full

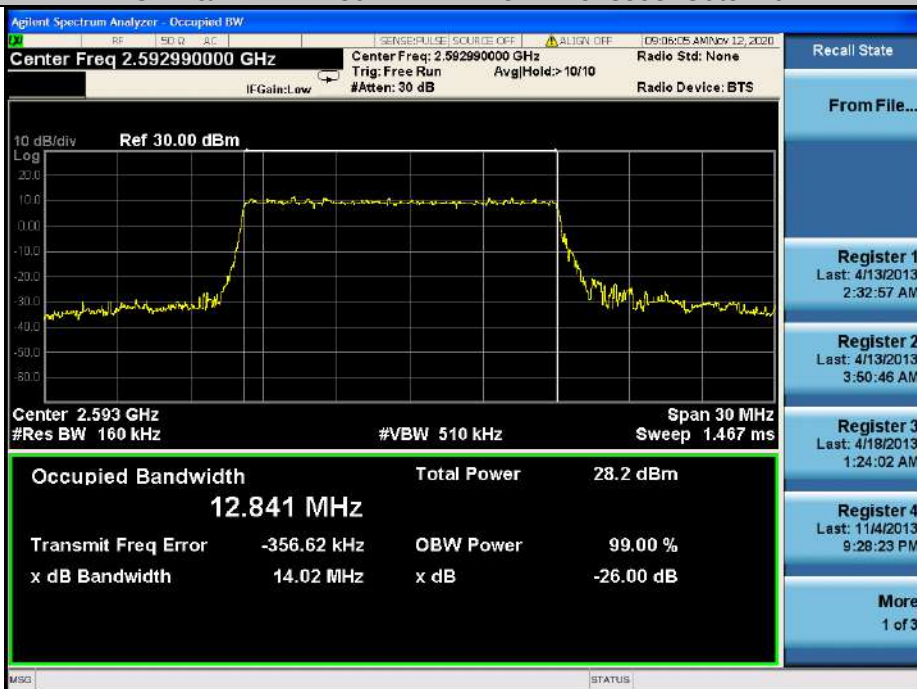





## OBW&amp;EBW N41 30KHz TM3 15MHz 518598 Outer Full

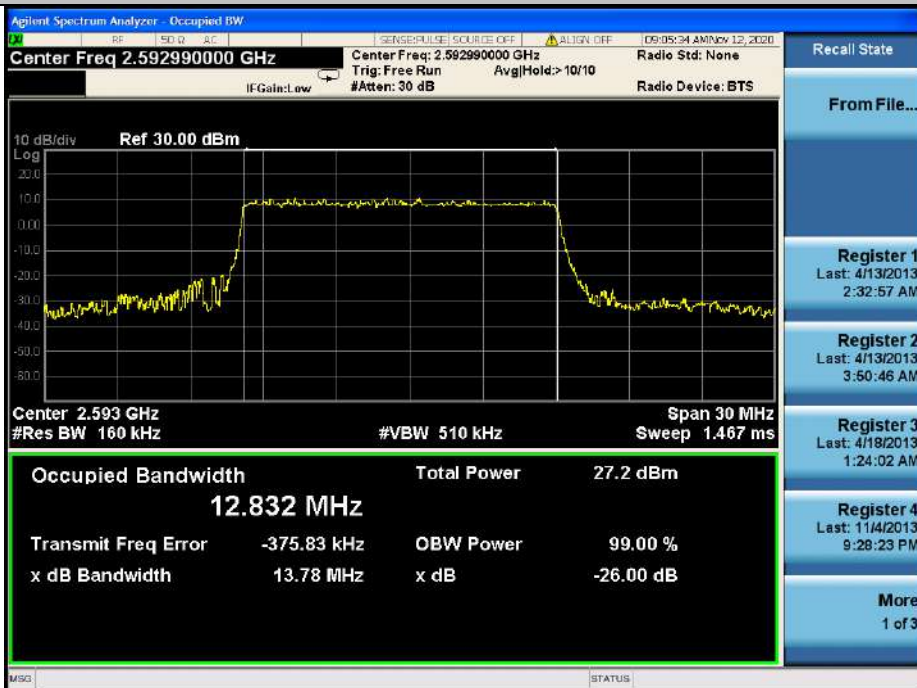


## OBW&amp;EBW N41 30KHz TM4 15MHz 518598 Outer Full

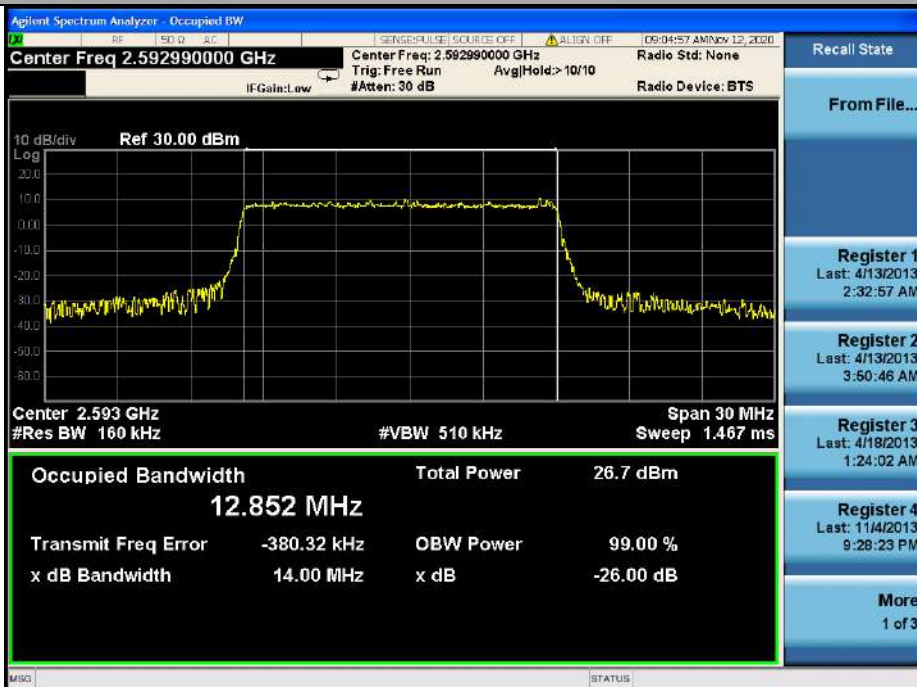


## OBW&EBW N41 30KHz TM5 15MHz 518598 Outer Full

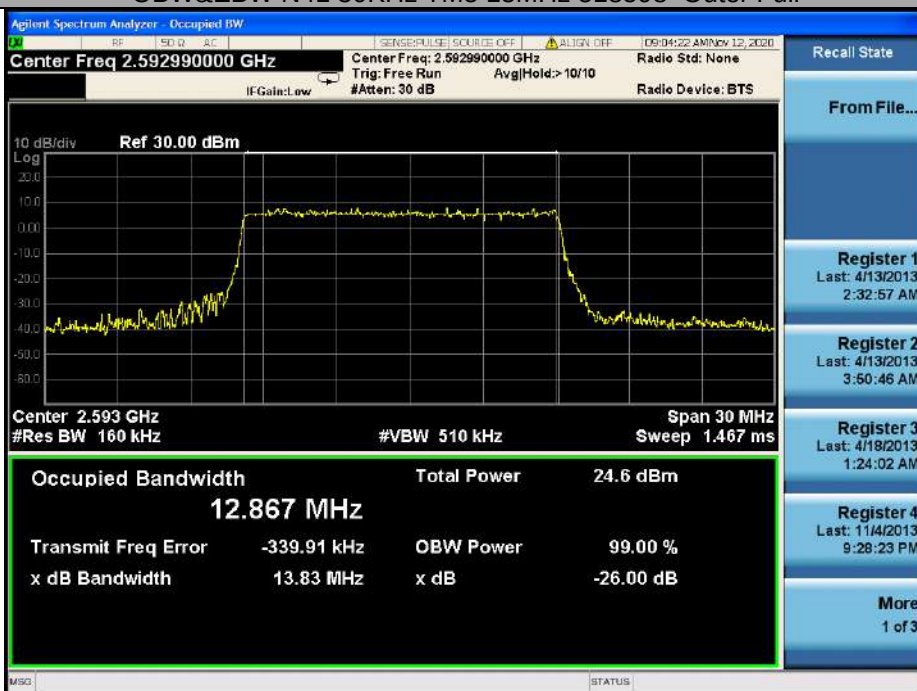


## OBW&EBW N41 30KHz TM6 15MHz 518598 Outer Full

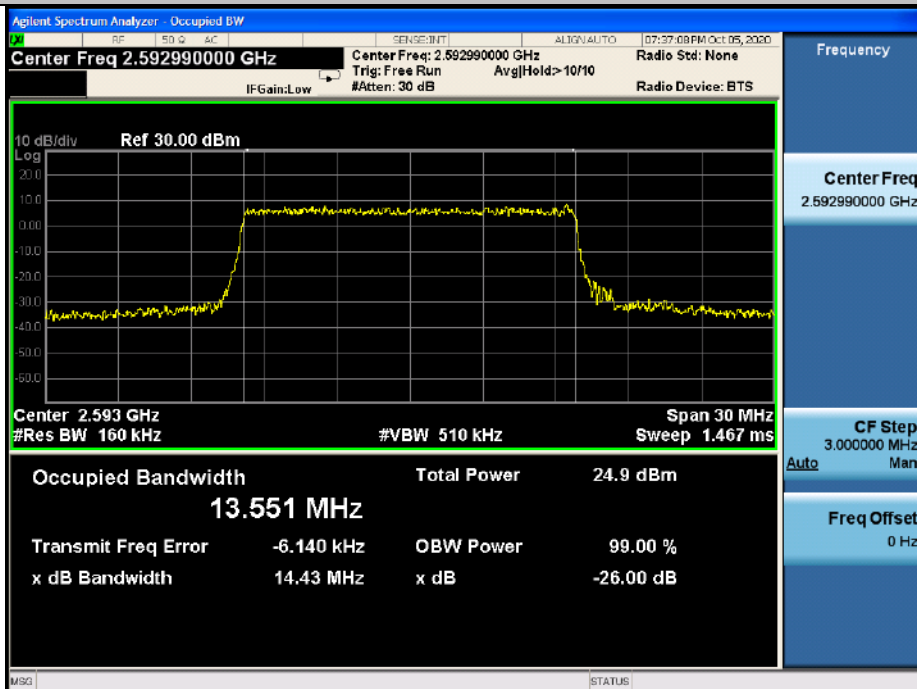

## OBW&EBW N41 30KHz TM7 15MHz 518598 Outer Full

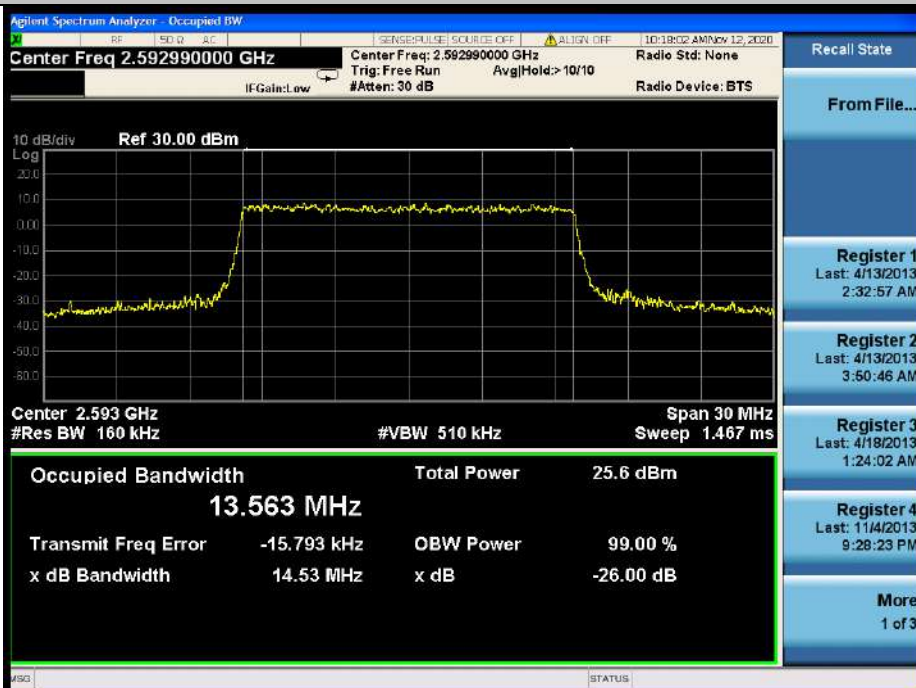

## OBW&EBW N41 30KHz TM8 15MHz 518598 Outer Full

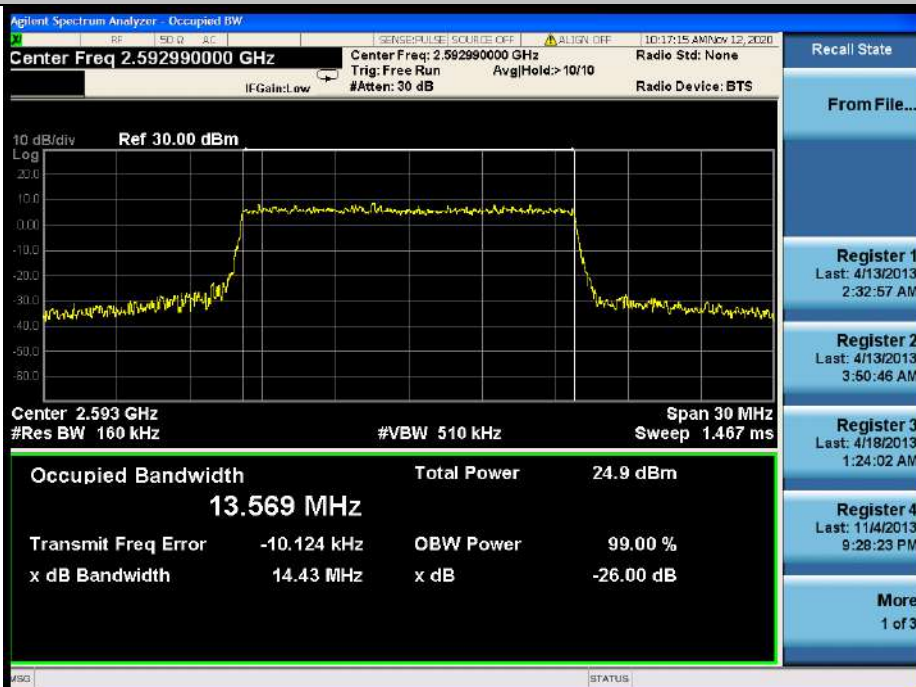

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

SGS-CSTC Standards Technical Services Co., Ltd.  
Shenzhen Branch Inspection & Testing Laboratory


No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057  
中国·深圳·科技园中区M-10栋一号厂房

t (86-755) 26012053 f (86-755) 26710594  
邮编: 518057 t (86-755) 26012053 f (86-755) 26710594


[www.sgsgroup.com.cn](http://www.sgsgroup.com.cn)  
[sgs.china@sgs.com](mailto:sgs.china@sgs.com)



## OBW&EBW N41 30KHz TM9 15MHz 518598 Outer Full

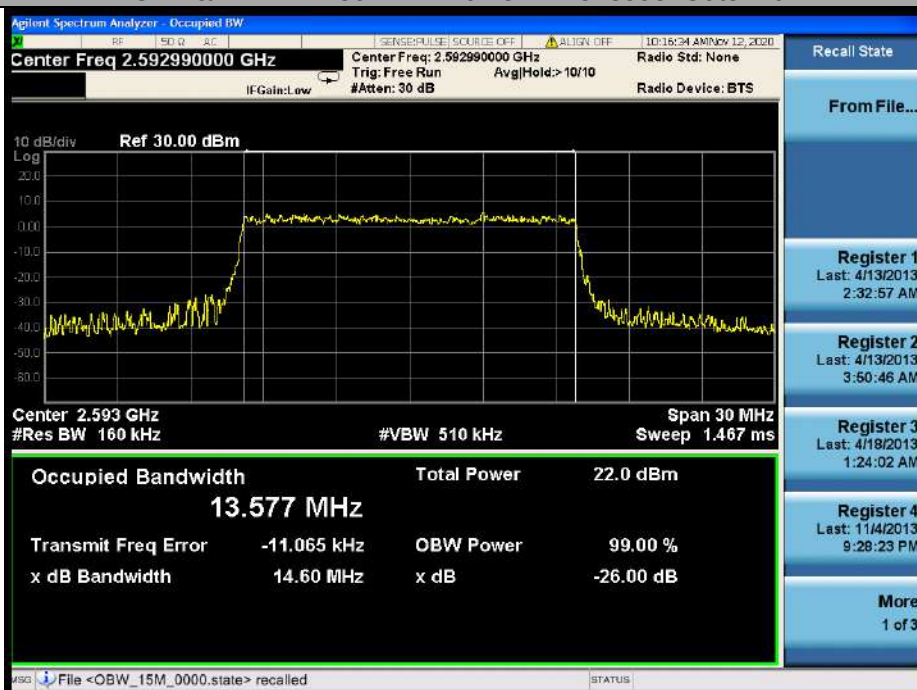


## OBW&EBW N41 30KHz TM1 20MHz 518598 Outer Full

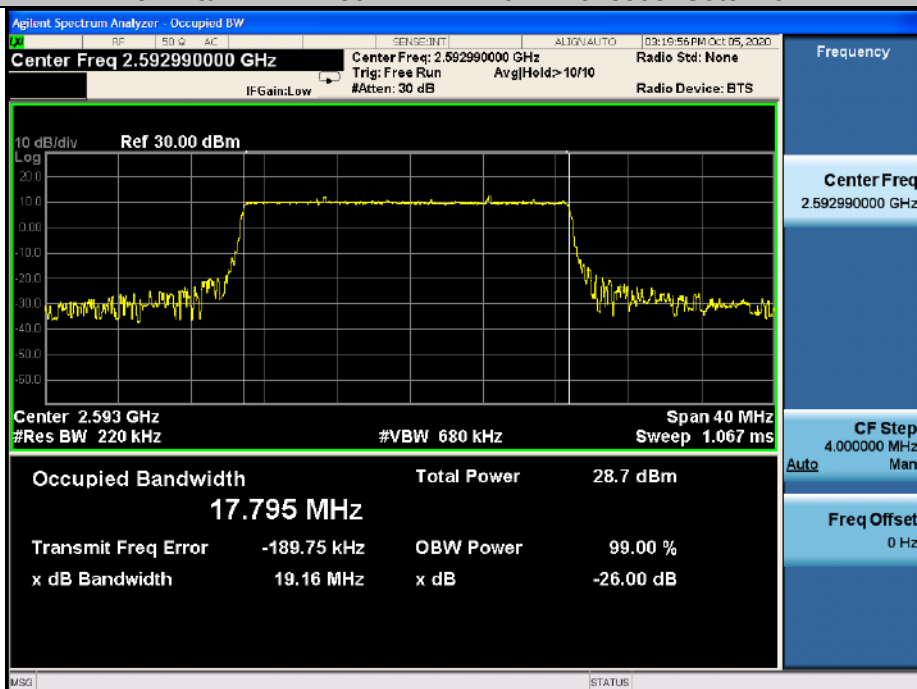


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)


## OBW&amp;EBW N41 30KHz TM2 20MHz 518598 Outer Full

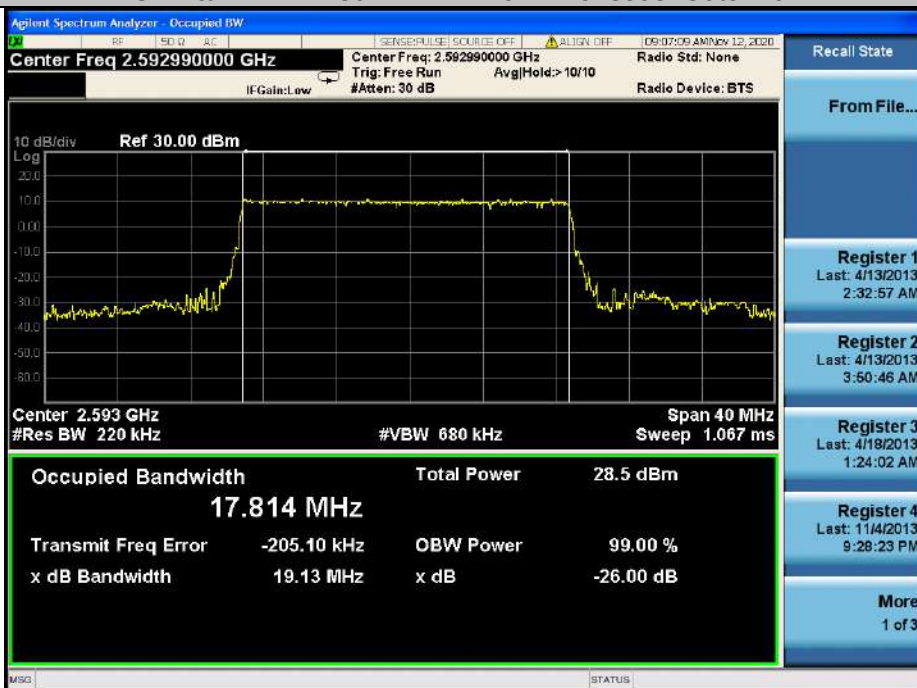


## OBW&amp;EBW N41 30KHz TM3 20MHz 518598 Outer Full

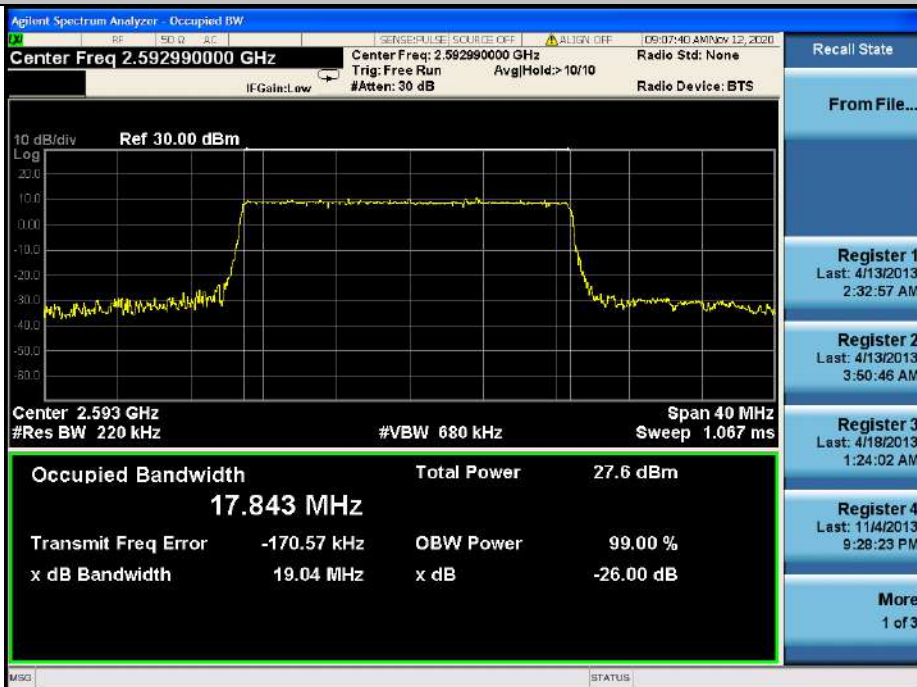

## OBW&EBW N41 30KHz TM4 20MHz 518598 Outer Full

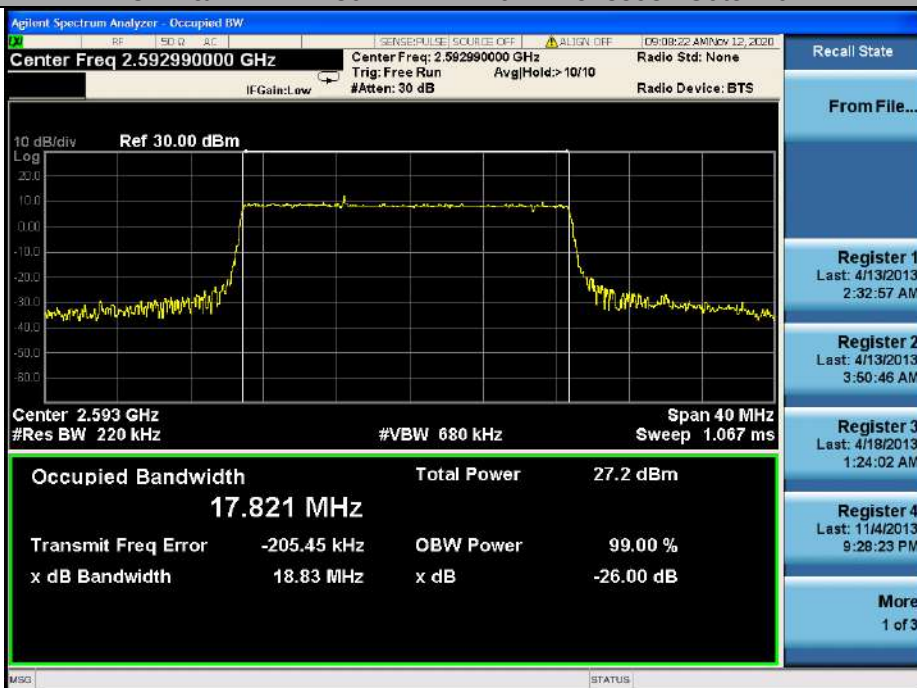

## OBW&EBW N41 30KHz TM5 20MHz 518598 Outer Full

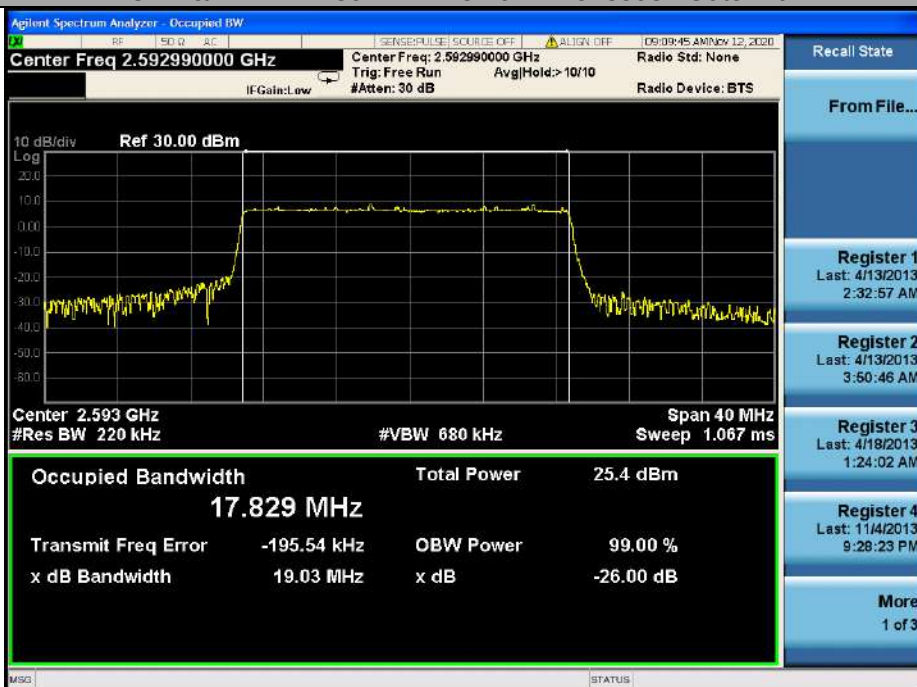


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.


Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



## OBW&EBW N41 30KHz TM6 20MHz 518598 Outer Full

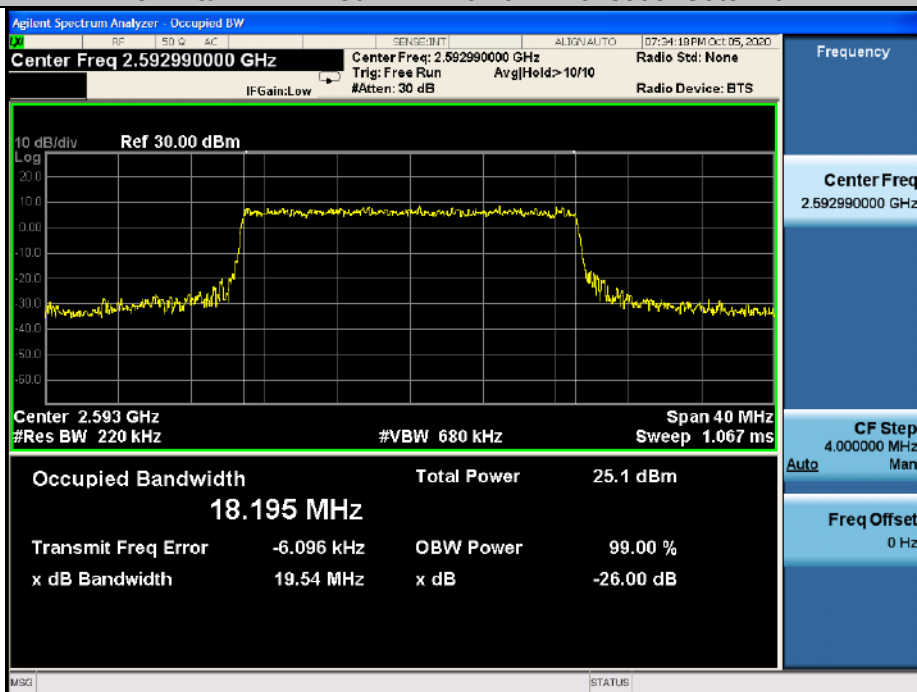


## OBW&EBW N41 30KHz TM7 20MHz 518598 Outer Full

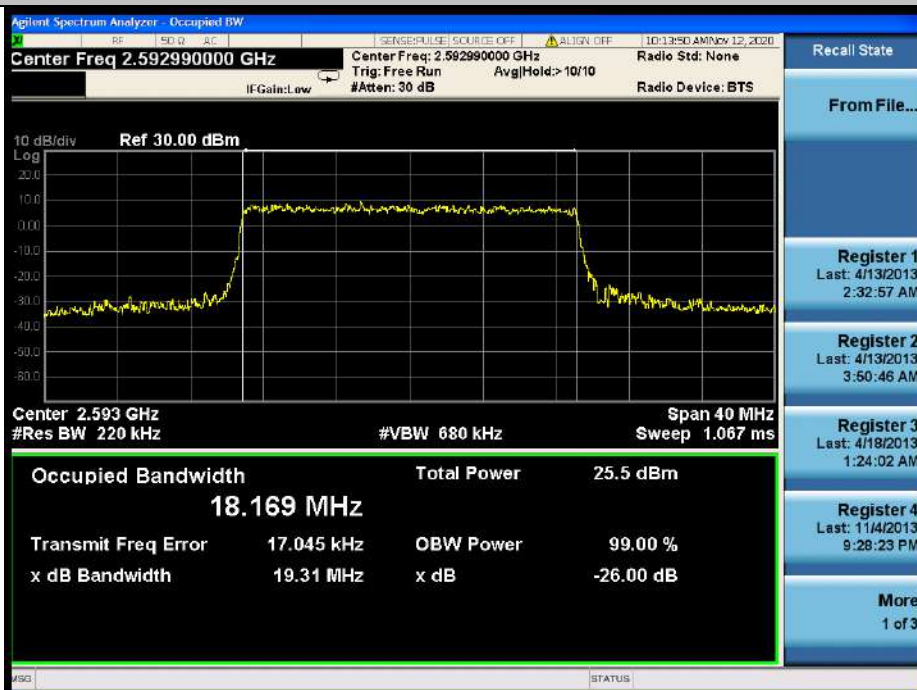


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)


## OBW&EBW N41 30KHz TM8 20MHz 518598 Outer Full

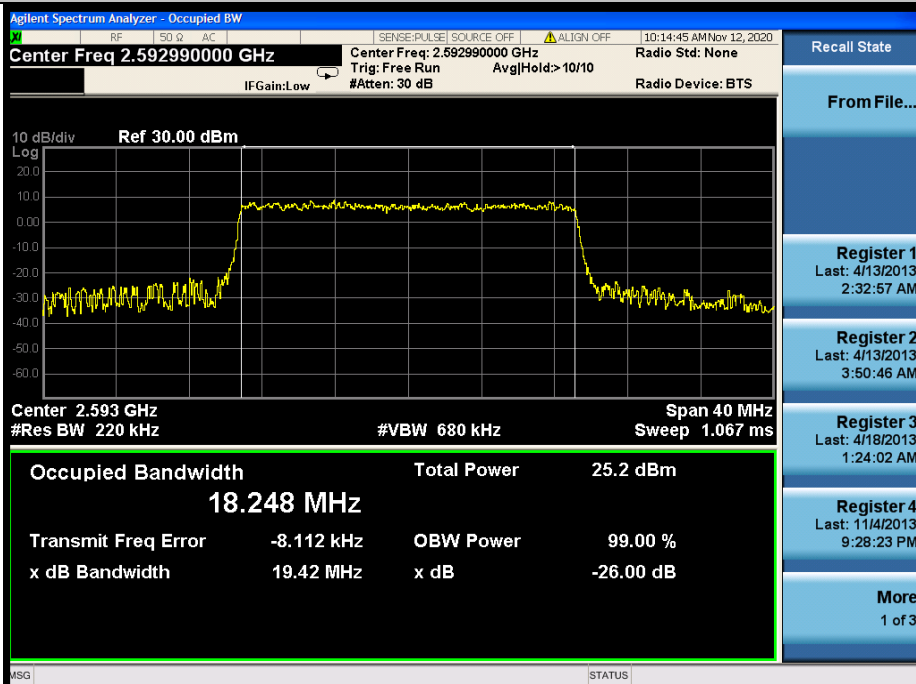


## OBW&EBW N41 30KHz TM9 20MHz 518598 Outer Full

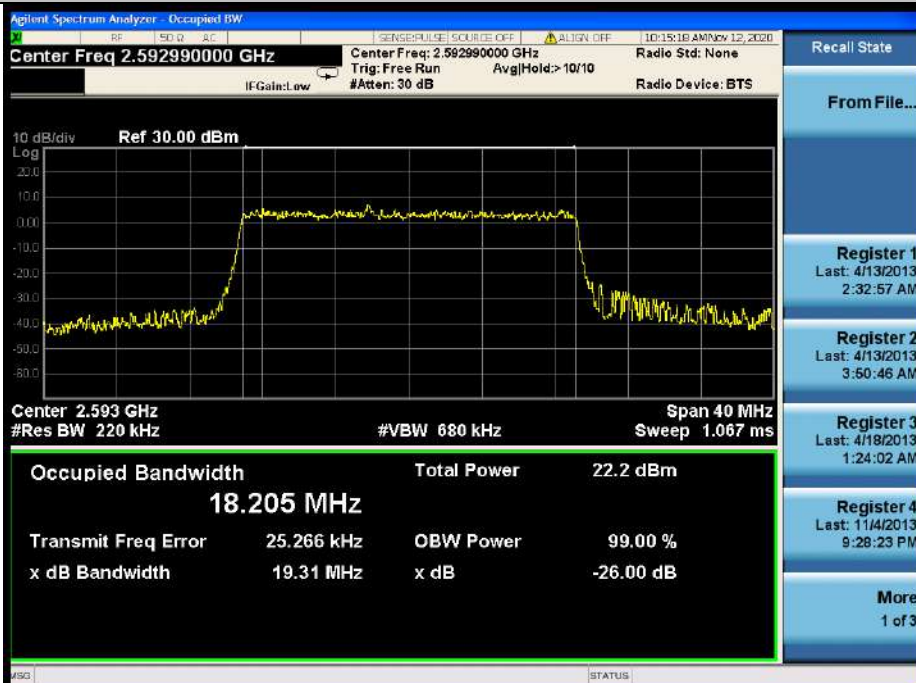

## OBW&amp;EBW N41 30KHz TM1 40MHz 518598 Outer Full

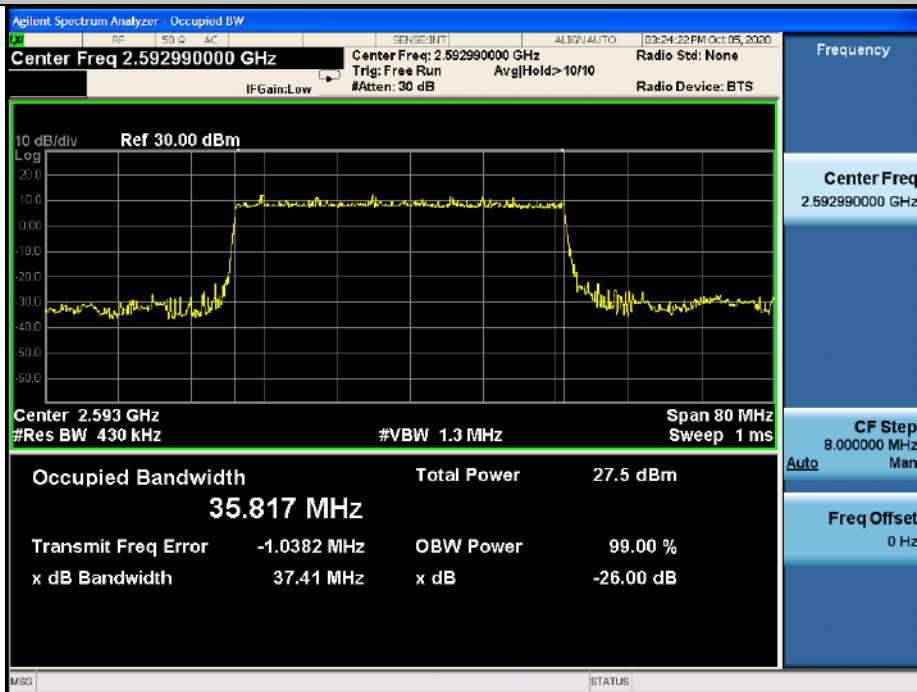


## OBW&amp;EBW N41 30KHz TM2 40MHz 518598 Outer Full

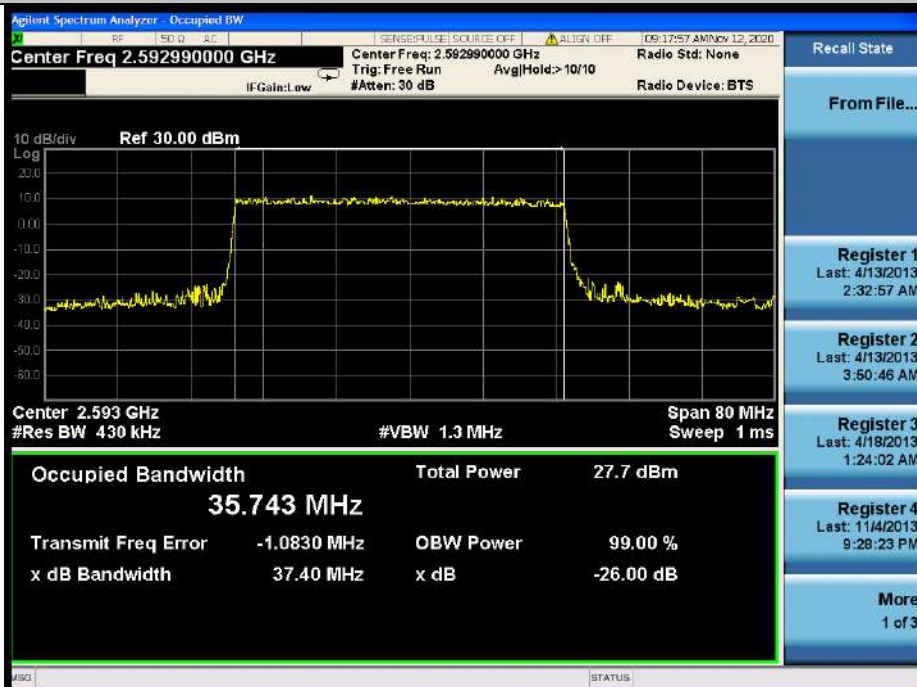




## OBW&EBW N41 30KHz TM3 40MHz 518598 Outer Full

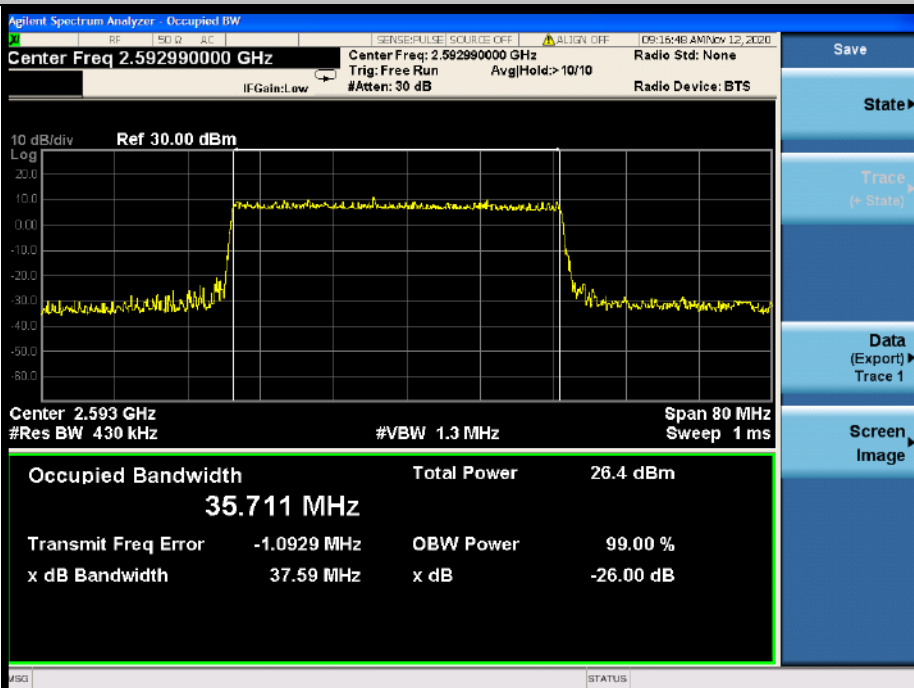


## OBW&EBW N41 30KHz TM4 40MHz 518598 Outer Full

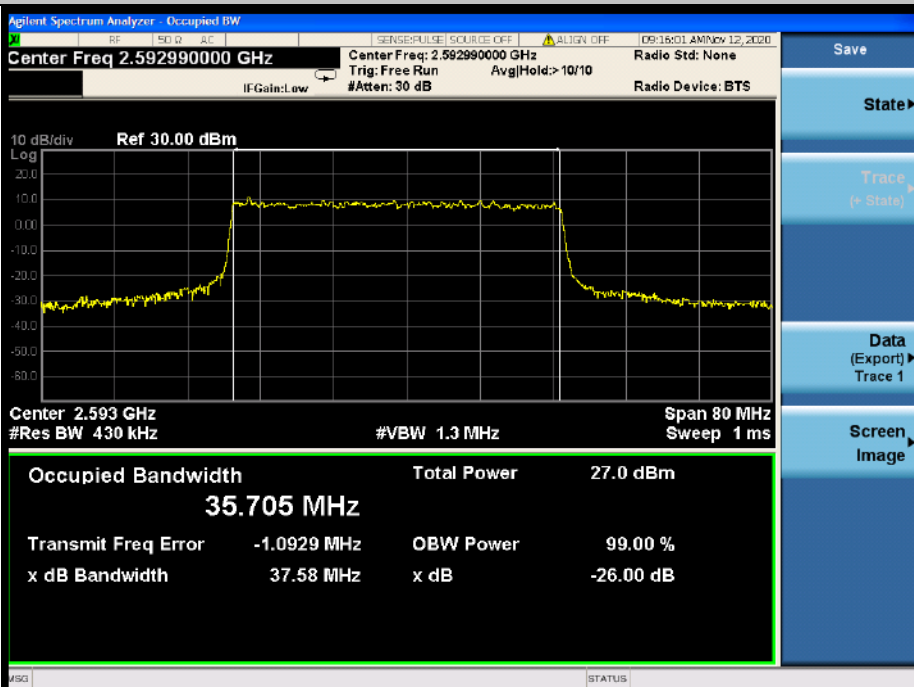


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&EBW N41 30KHz TM5 40MHz 518598 Outer Full

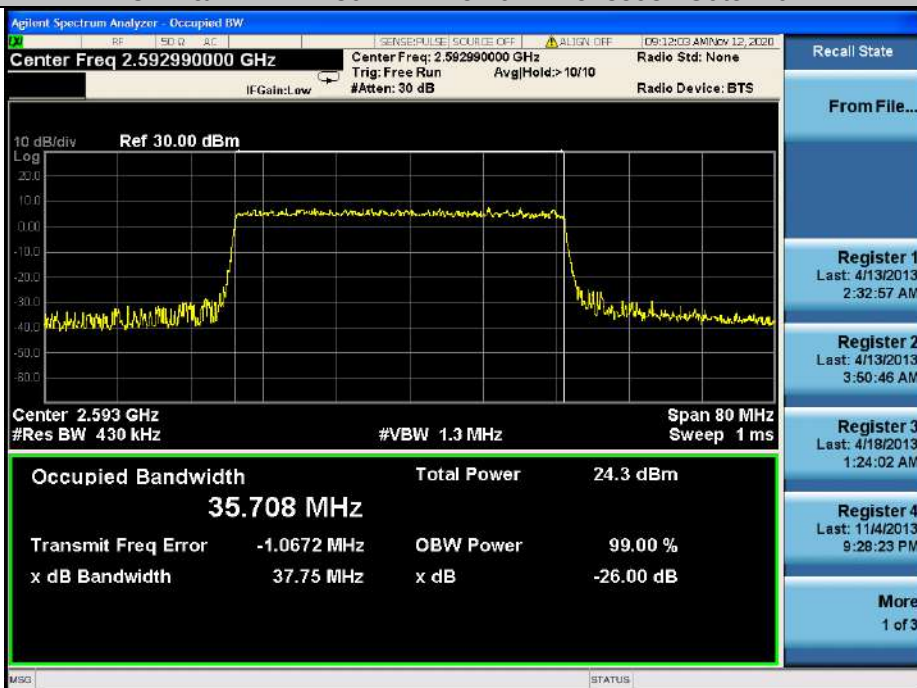


## OBW&EBW N41 30KHz TM6 40MHz 518598 Outer Full

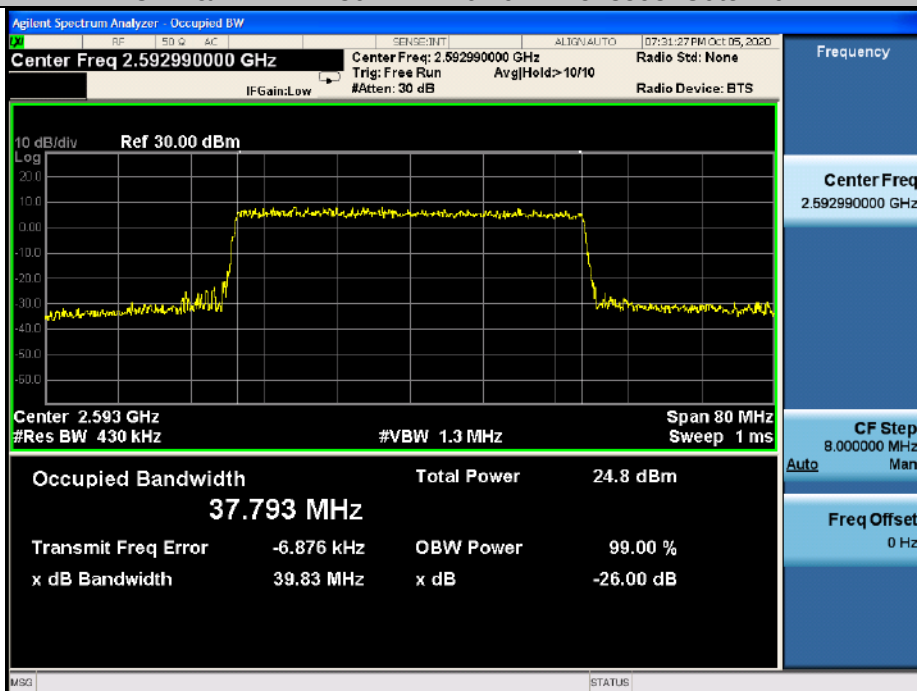


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)  
 No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgs.com.cn  
 中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

## OBW&EBW N41 30KHz TM7 40MHz 518598 Outer Full

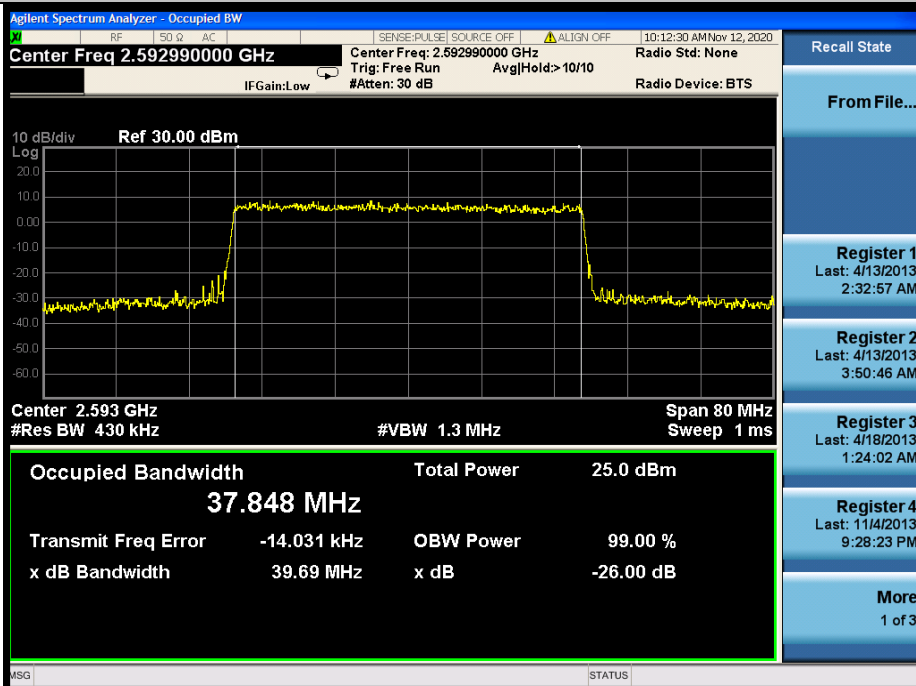

## OBW&EBW N41 30KHz TM8 40MHz 518598 Outer Full

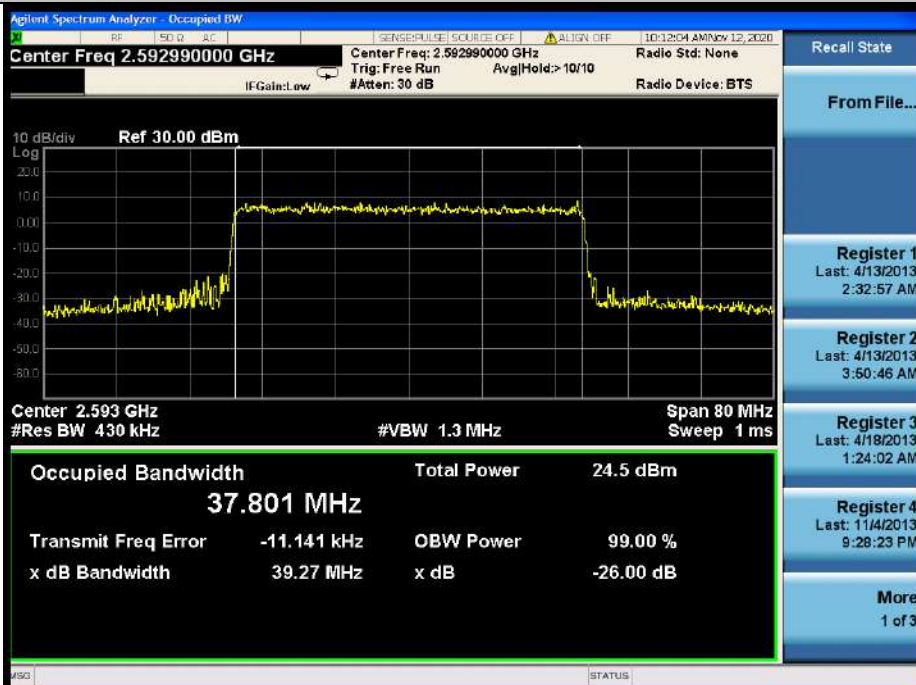


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.


Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)



## OBW&EBW N41 30KHz TM9 40MHz 518598 Outer Full

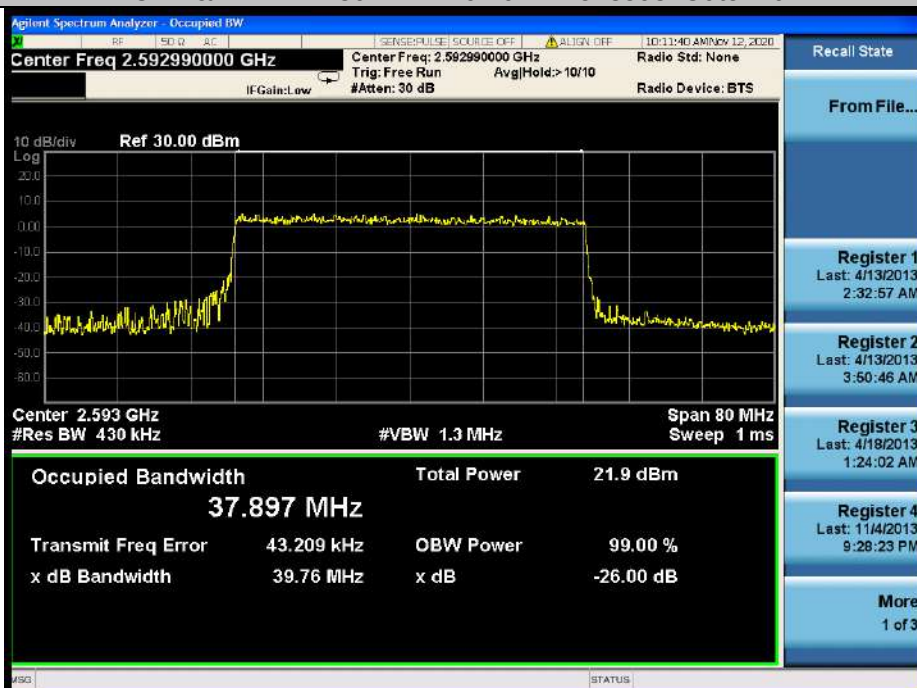


## OBW&EBW N41 30KHz TM1 50MHz 518598 Outer Full

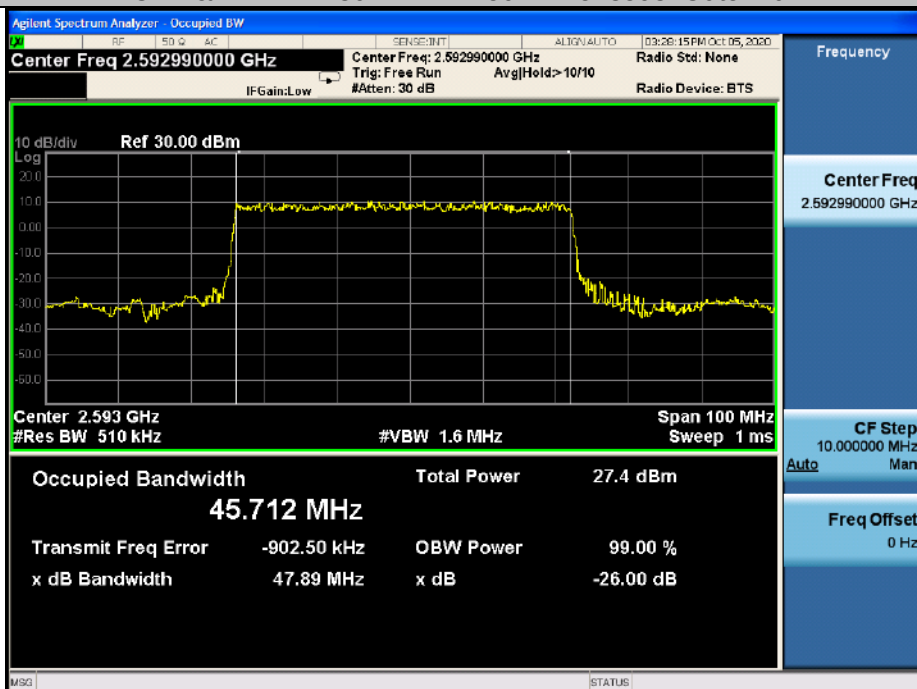


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)  
 No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 www.sgsgroup.com.cn  
 中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 sgs.china@sgs.com

## OBW&EBW N41 30KHz TM2 50MHz 518598 Outer Full

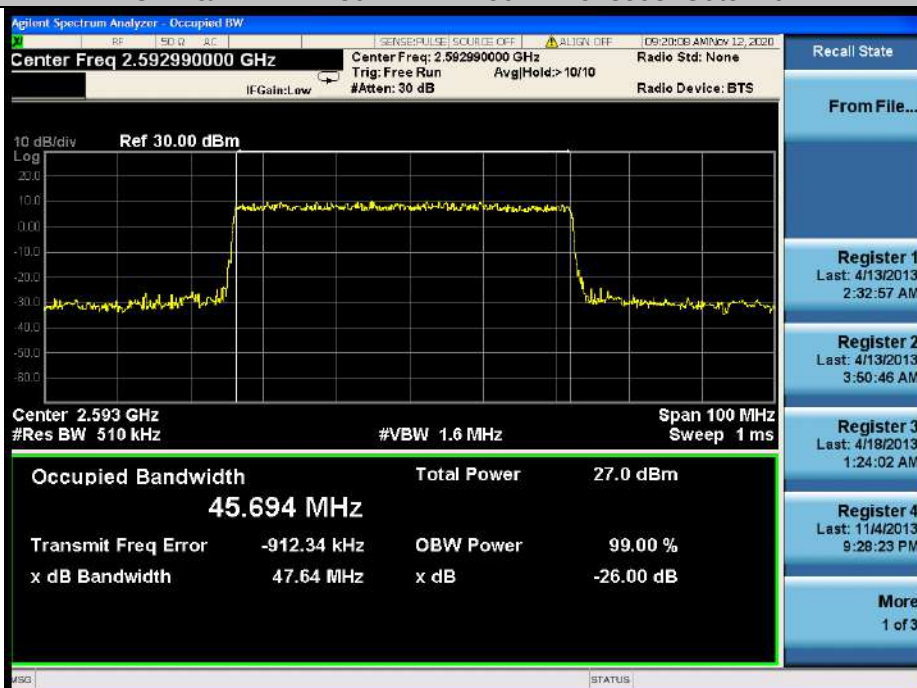


## OBW&EBW N41 30KHz TM3 50MHz 518598 Outer Full

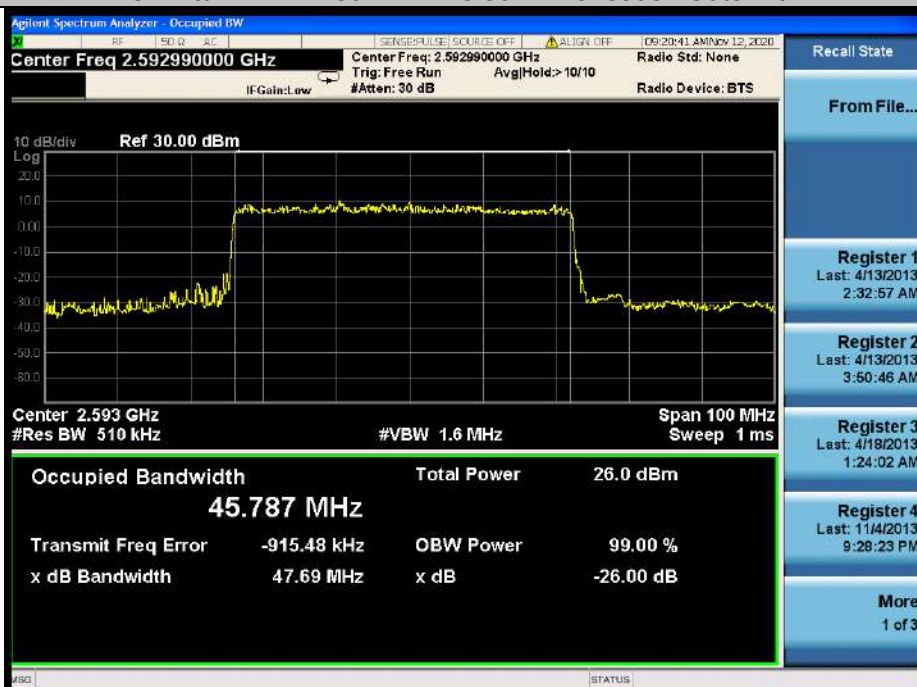


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&EBW N41 30KHz TM4 50MHz 518598 Outer Full

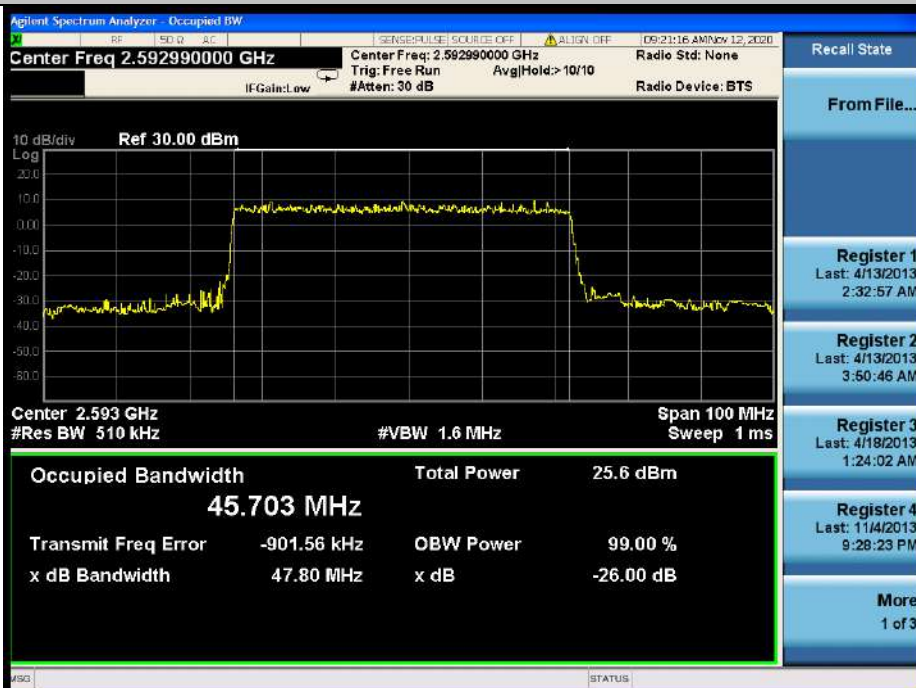

## OBW&EBW N41 30KHz TM5 50MHz 518598 Outer Full

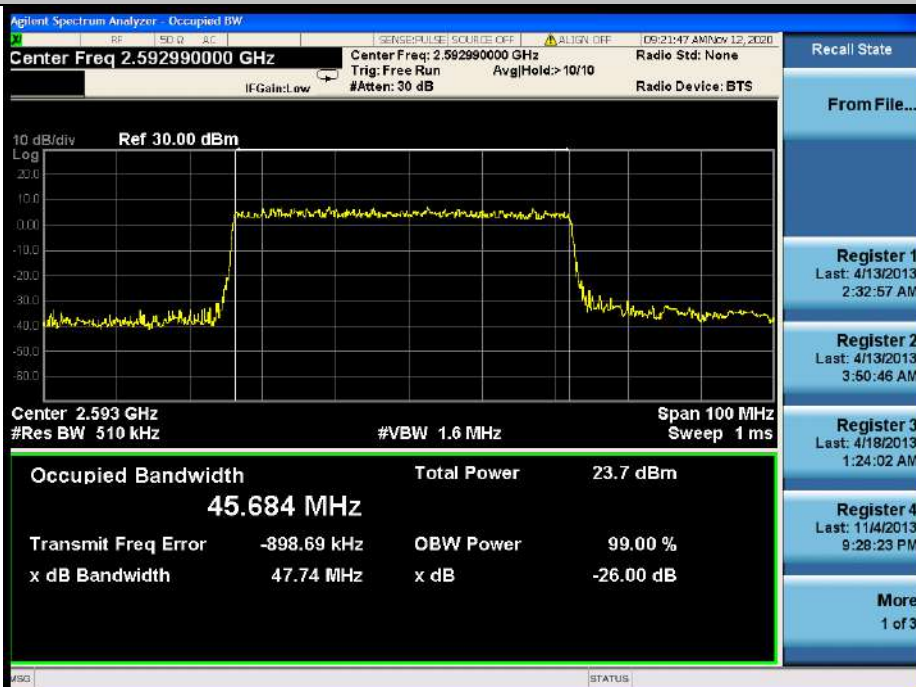


Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.


Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)




## OBW&amp;EBW N41 30KHz TM6 50MHz 518598 Outer Full

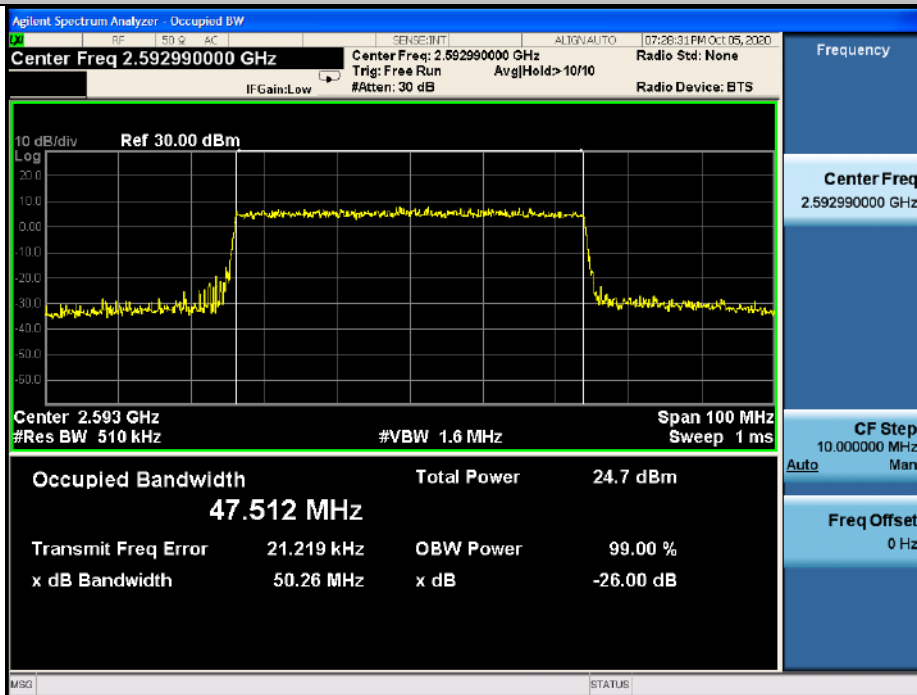


## OBW&amp;EBW N41 30KHz TM7 50MHz 518598 Outer Full

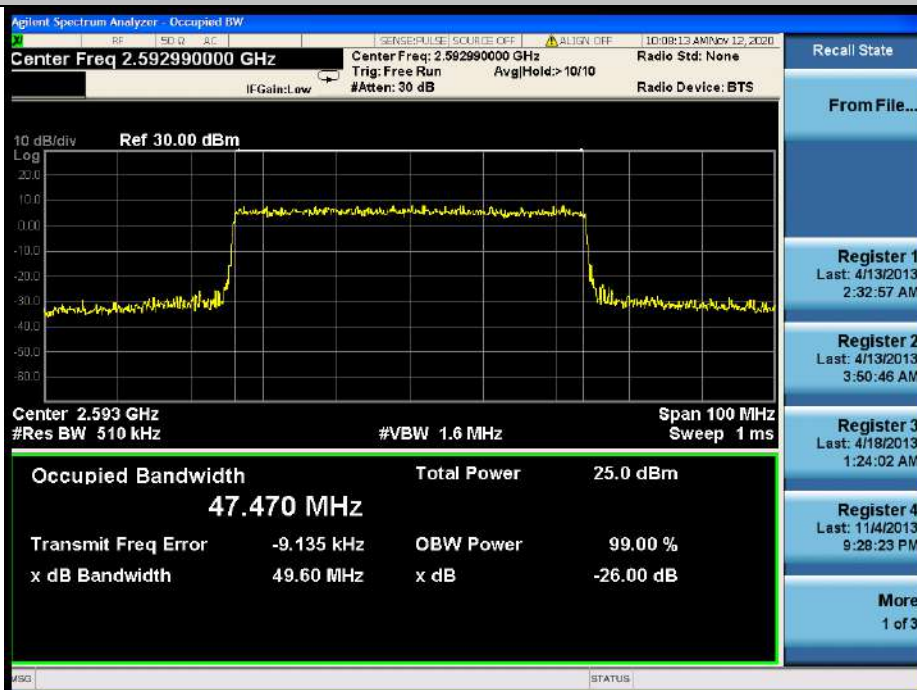

## OBW&amp;EBW N41 30KHz TM8 50MHz 518598 Outer Full

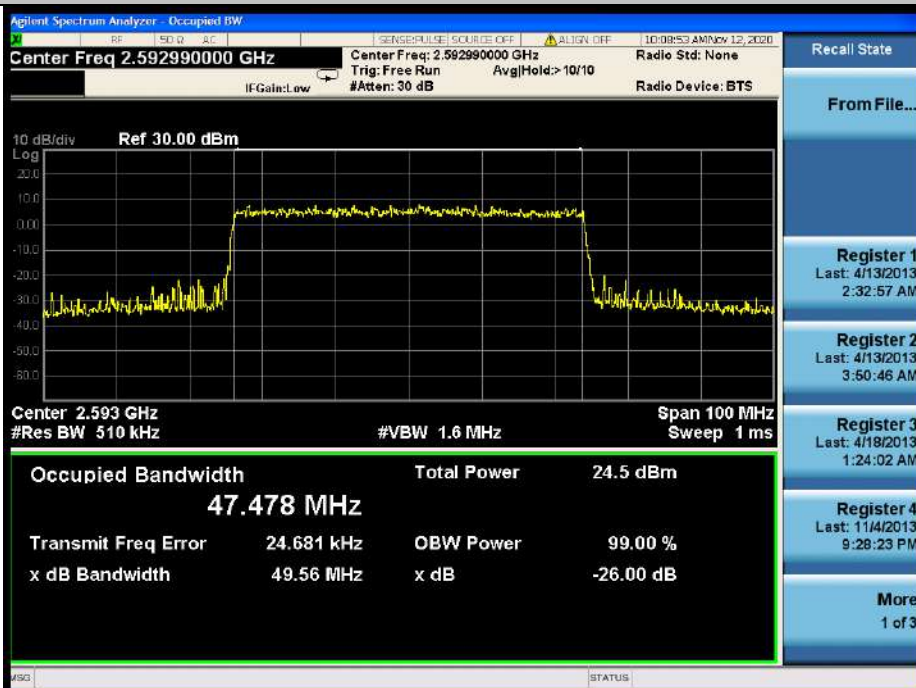


## OBW&amp;EBW N41 30KHz TM9 50MHz 518598 Outer Full

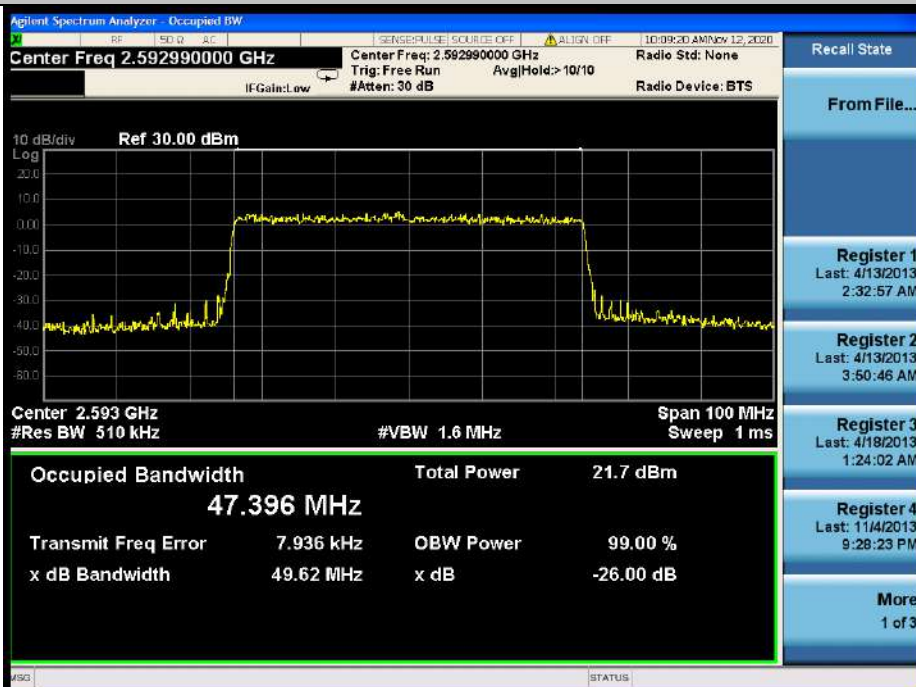

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&amp;EBW N41 30KHz TM1 60MHz 518598 Outer Full

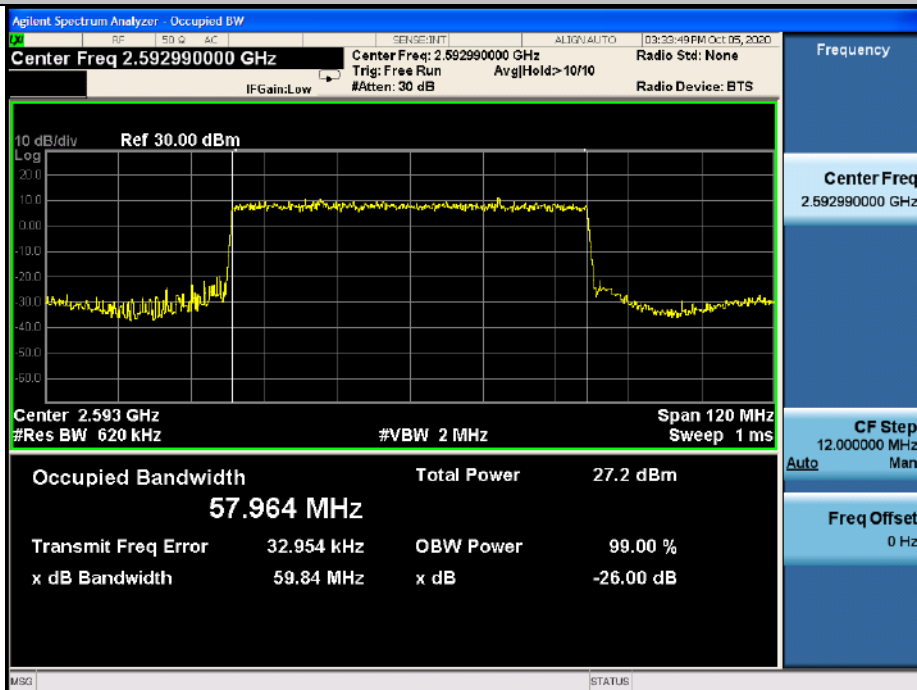


## OBW&amp;EBW N41 30KHz TM2 60MHz 518598 Outer Full





## OBW&EBW N41 30KHz TM3 60MHz 518598 Outer Full

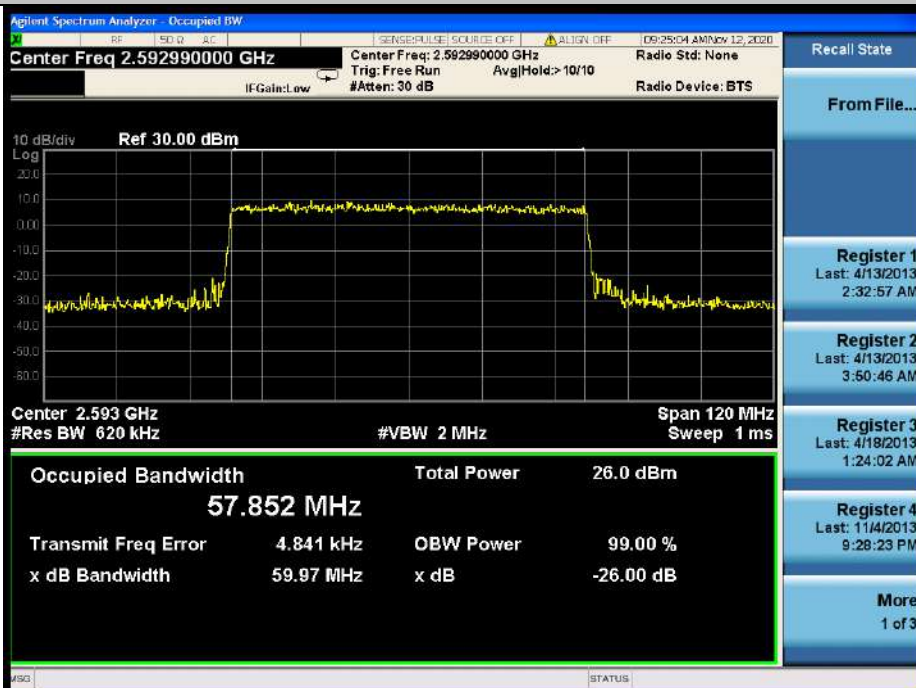


## OBW&EBW N41 30KHz TM4 60MHz 518598 Outer Full




Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

## OBW&EBW N41 30KHz TM5 60MHz 518598 Outer Full

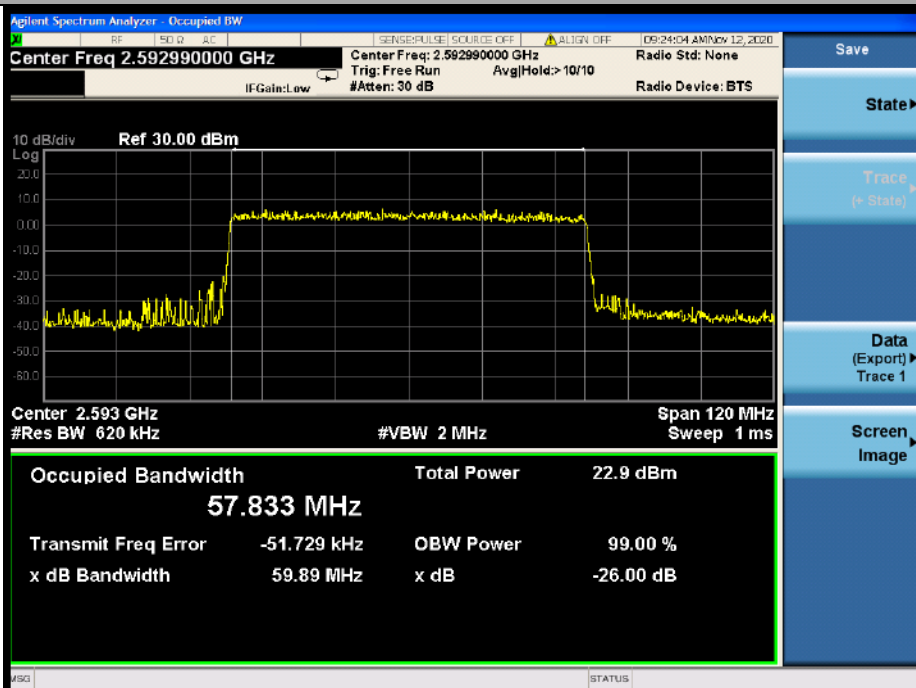

## OBW&EBW N41 30KHz TM6 60MHz 518598 Outer Full

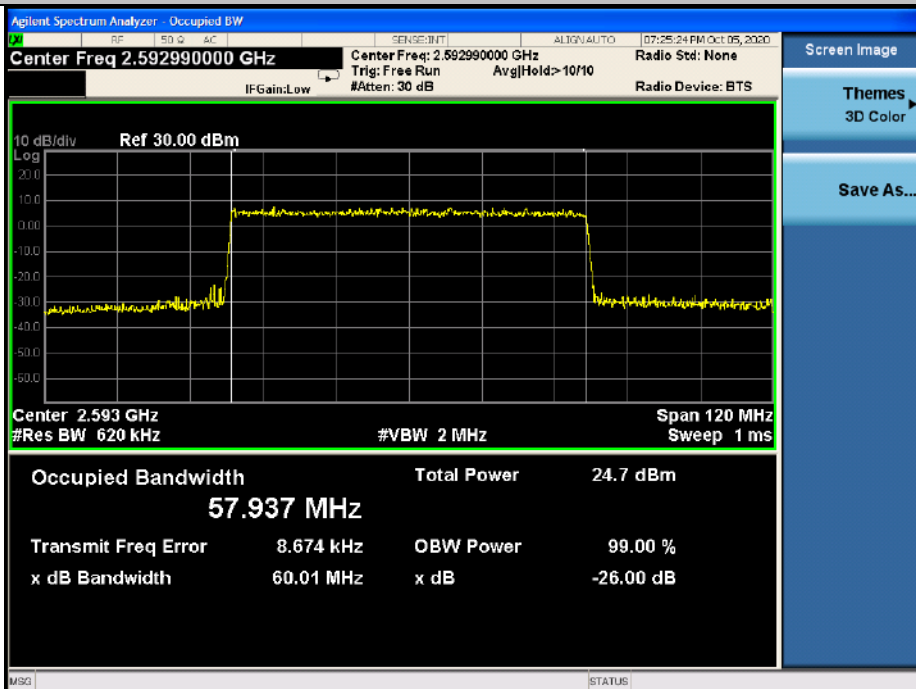

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: [CN.Doccheck@sgs.com](mailto:CN.Doccheck@sgs.com)

No. 1 Workshop, M-10, Middle Section, Science & Technology Park, Shenzhen, China 518057 t (86-755) 26012053 f (86-755) 26710594 [www.sgsgroup.com.cn](http://www.sgsgroup.com.cn)  
中国·深圳·科技园中区M-10栋一号厂房 邮编: 518057 t (86-755) 26012053 f (86-755) 26710594 [sgs.china@sgs.com](mailto:sgs.china@sgs.com)