

## Appendix Test Data

Report No.:	1813C50315912503	Test Sample No.:	1-2-2
Start Test Date:	2025-7-14	Finish Test Date:	2025-8-6
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	26.2°C	Relative Humidity:	55%
Pressure:	101kPa		

## Appendix A1: 26dB Bandwidth

### Test Result

Test Mode	Antenna	Frequency [MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	22.36	5168.84	5191.20	---	---
11A	Ant1	5200	23.52	5187.04	5210.56	---	---
11A	Ant1	5240	21.72	5229.36	5251.08	---	---
11A	Ant1	5260	22.92	5248.16	5271.08	---	---
11A	Ant1	5280	22.08	5268.80	5290.88	---	---
11A	Ant1	5320	22.80	5308.44	5331.24	---	---
11A	Ant1	5500	22.32	5488.84	5511.16	---	---
11A	Ant1	5580	22.08	5569.04	5591.12	---	---
11A	Ant1	5700	22.88	5688.24	5711.12	---	---
11A	Ant1	5745	25.12	5732.04	5757.16	---	---
11A	Ant1	5785	22.20	5773.80	5796.00	---	---
11A	Ant1	5825	23.08	5812.92	5836.00	---	---
11N20SISO	Ant1	5180	24.96	5167.00	5191.96	---	---
11N20SISO	Ant1	5200	23.36	5188.36	5211.72	---	---
11N20SISO	Ant1	5240	23.40	5228.52	5251.92	---	---
11N20SISO	Ant1	5260	23.48	5248.60	5272.08	---	---
11N20SISO	Ant1	5280	23.80	5268.20	5292.00	---	---
11N20SISO	Ant1	5320	22.64	5308.60	5331.24	---	---
11N20SISO	Ant1	5500	24.76	5488.52	5513.28	---	---
11N20SISO	Ant1	5580	24.32	5567.84	5592.16	---	---
11N20SISO	Ant1	5700	24.68	5688.56	5713.24	---	---
11N20SISO	Ant1	5745	24.76	5733.04	5757.80	---	---
11N20SISO	Ant1	5785	24.16	5772.64	5796.80	---	---
11N20SISO	Ant1	5825	22.88	5813.56	5836.44	---	---
11N40SISO	Ant1	5190	44.88	5167.28	5212.16	---	---

11N40SISO	Ant1	5230	44.48	5206.88	5251.36	---	---
11N40SISO	Ant1	5270	44.72	5246.96	5291.68	---	---
11N40SISO	Ant1	5310	45.04	5287.52	5332.56	---	---
11N40SISO	Ant1	5510	46.40	5486.96	5533.36	---	---
11N40SISO	Ant1	5550	44.48	5528.16	5572.64	---	---
11N40SISO	Ant1	5670	45.84	5647.04	5692.88	---	---
11N40SISO	Ant1	5755	45.04	5732.20	5777.24	---	---
11N40SISO	Ant1	5795	45.60	5771.96	5817.56	---	---
11AC20SISO	Ant1	5180	21.80	5169.12	5190.92	---	---
11AC20SISO	Ant1	5200	23.52	5188.20	5211.72	---	---
11AC20SISO	Ant1	5240	23.00	5228.64	5251.64	---	---
11AC20SISO	Ant1	5260	24.32	5247.96	5272.28	---	---
11AC20SISO	Ant1	5280	23.32	5268.36	5291.68	---	---
11AC20SISO	Ant1	5320	24.36	5307.72	5332.08	---	---
11AC20SISO	Ant1	5500	24.92	5487.88	5512.80	---	---
11AC20SISO	Ant1	5580	23.28	5568.24	5591.52	---	---
11AC20SISO	Ant1	5700	24.04	5687.72	5711.76	---	---
11AC20SISO	Ant1	5745	24.32	5732.80	5757.12	---	---
11AC20SISO	Ant1	5785	25.04	5772.68	5797.72	---	---
11AC20SISO	Ant1	5825	23.84	5813.32	5837.16	---	---
11AC40SISO	Ant1	5190	45.28	5167.68	5212.96	---	---
11AC40SISO	Ant1	5230	45.84	5207.04	5252.88	---	---
11AC40SISO	Ant1	5270	44.88	5246.80	5291.68	---	---
11AC40SISO	Ant1	5310	44.80	5286.88	5331.68	---	---
11AC40SISO	Ant1	5510	46.08	5487.28	5533.36	---	---
11AC40SISO	Ant1	5550	45.84	5526.40	5572.24	---	---
11AC40SISO	Ant1	5670	46.00	5646.48	5692.48	---	---
11AC40SISO	Ant1	5755	45.44	5732.44	5777.88	---	---
11AC40SISO	Ant1	5795	45.20	5771.96	5817.16	---	---
11AC80SISO	Ant1	5210	86.08	5166.80	5252.88	---	---
11AC80SISO	Ant1	5290	86.56	5246.96	5333.52	---	---
11AC80SISO	Ant1	5530	86.24	5486.64	5572.88	---	---
11AC80SISO	Ant1	5610	88.48	5566.80	5655.28	---	---
11AC80SISO	Ant1	5775	87.36	5730.84	5818.20	---	---
11AX20SISO	Ant1	5180	23.24	5168.80	5192.04	---	---
11AX20SISO	Ant1	5200	23.08	5188.12	5211.20	---	---
11AX20SISO	Ant1	5240	22.68	5228.52	5251.20	---	---
11AX20SISO	Ant1	5260	23.60	5249.04	5272.64	---	---
11AX20SISO	Ant1	5280	24.00	5268.36	5292.36	---	---
11AX20SISO	Ant1	5320	22.32	5308.48	5330.80	---	---
11AX20SISO	Ant1	5500	23.64	5487.84	5511.48	---	---
11AX20SISO	Ant1	5580	21.96	5569.20	5591.16	---	---


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

11AX20SISO	Ant1	5700	24.08	5687.88	5711.96	---	---
11AX20SISO	Ant1	5745	25.00	5732.16	5757.16	---	---
11AX20SISO	Ant1	5785	23.20	5773.64	5796.84	---	---
11AX20SISO	Ant1	5825	22.68	5813.84	5836.52	---	---
11AX40SISO	Ant1	5190	44.00	5168.56	5212.56	---	---
11AX40SISO	Ant1	5230	41.68	5209.60	5251.28	---	---
11AX40SISO	Ant1	5270	44.16	5247.68	5291.84	---	---
11AX40SISO	Ant1	5310	43.52	5288.48	5332.00	---	---
11AX40SISO	Ant1	5510	44.16	5488.08	5532.24	---	---
11AX40SISO	Ant1	5550	42.16	5528.96	5571.12	---	---
11AX40SISO	Ant1	5670	45.68	5647.20	5692.88	---	---
11AX40SISO	Ant1	5755	45.60	5732.44	5778.04	---	---
11AX40SISO	Ant1	5795	43.76	5773.64	5817.40	---	---
11AX80SISO	Ant1	5210	84.80	5166.80	5251.60	---	---
11AX80SISO	Ant1	5290	83.68	5248.72	5332.40	---	---
11AX80SISO	Ant1	5530	85.92	5486.64	5572.56	---	---
11AX80SISO	Ant1	5610	86.24	5567.92	5654.16	---	---
11AX80SISO	Ant1	5775	85.12	5733.24	5818.36	---	---


## Test Graphs

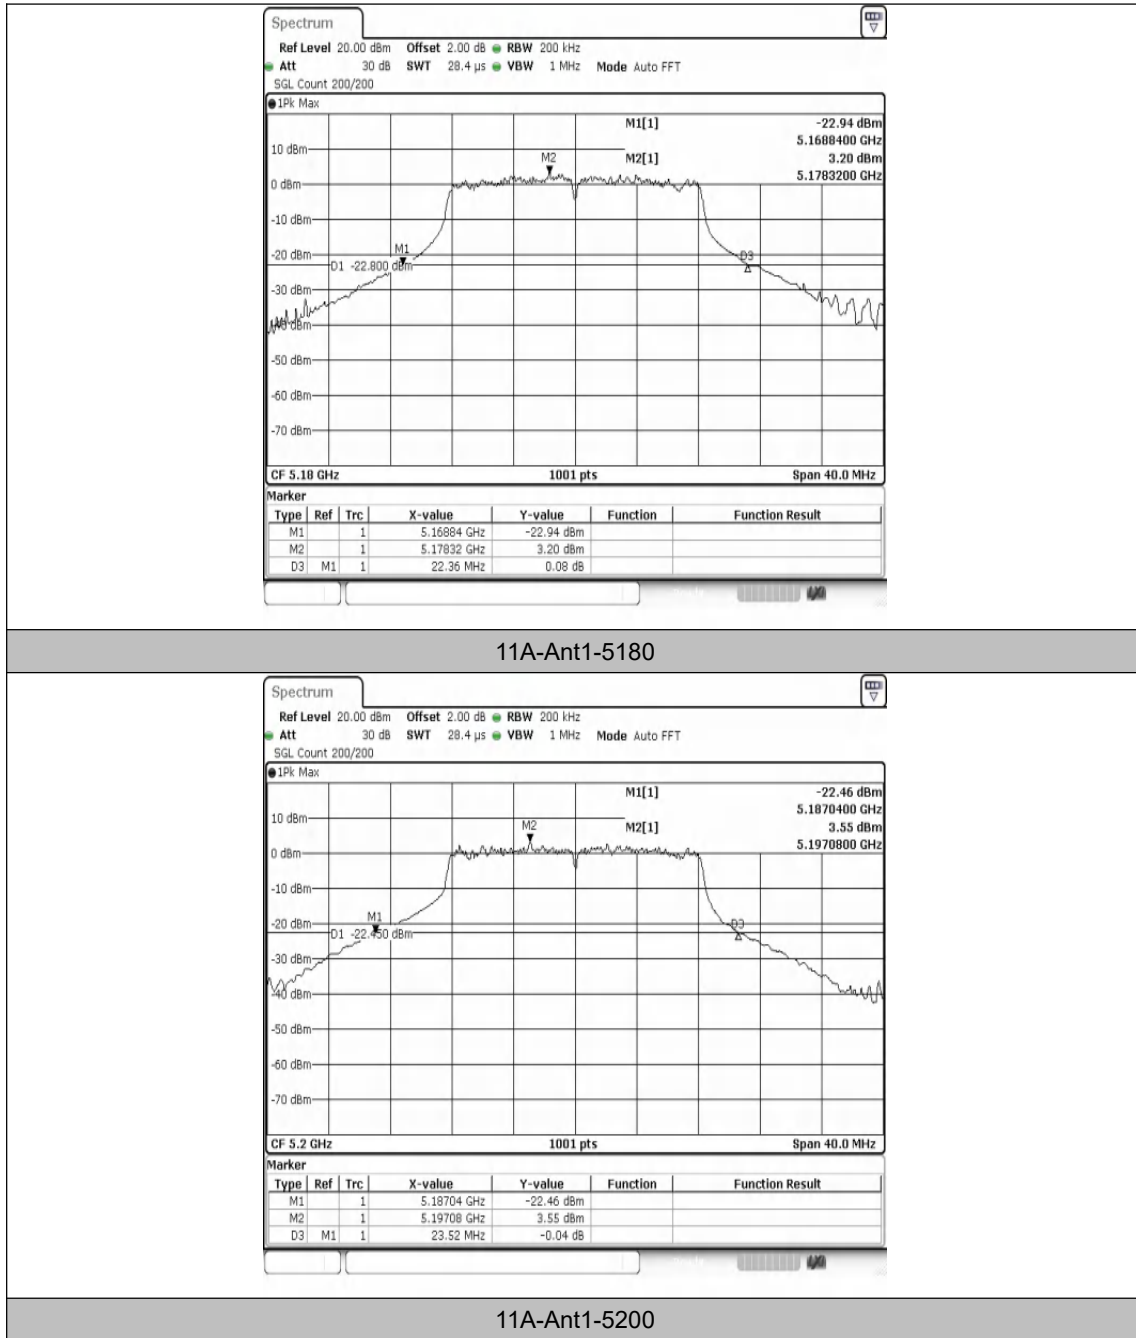


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

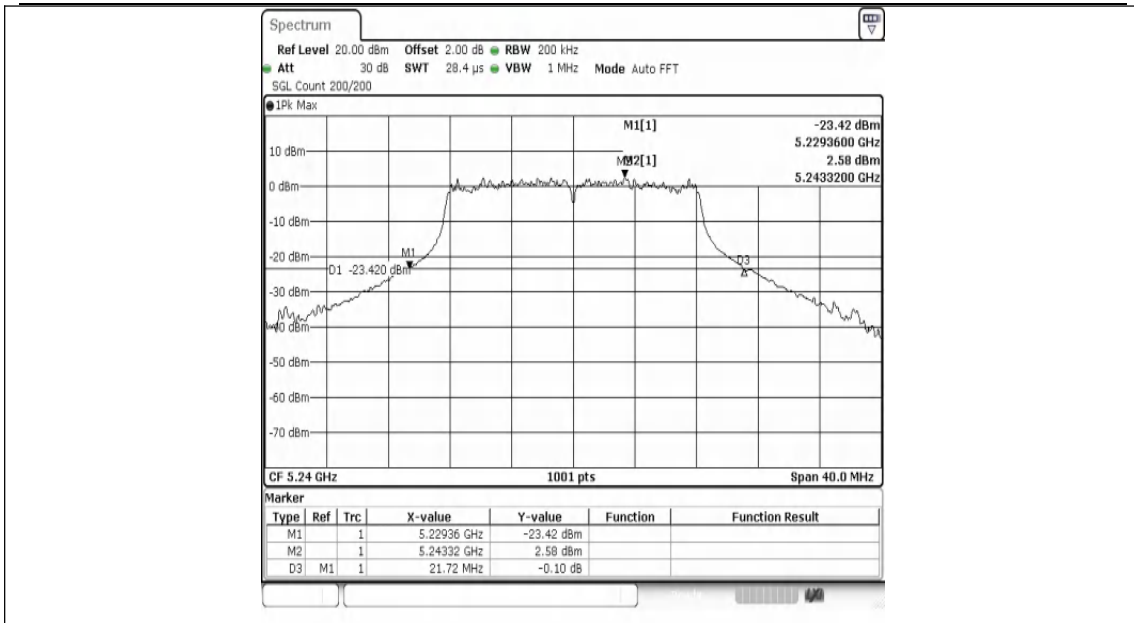


11A-Ant1-5240

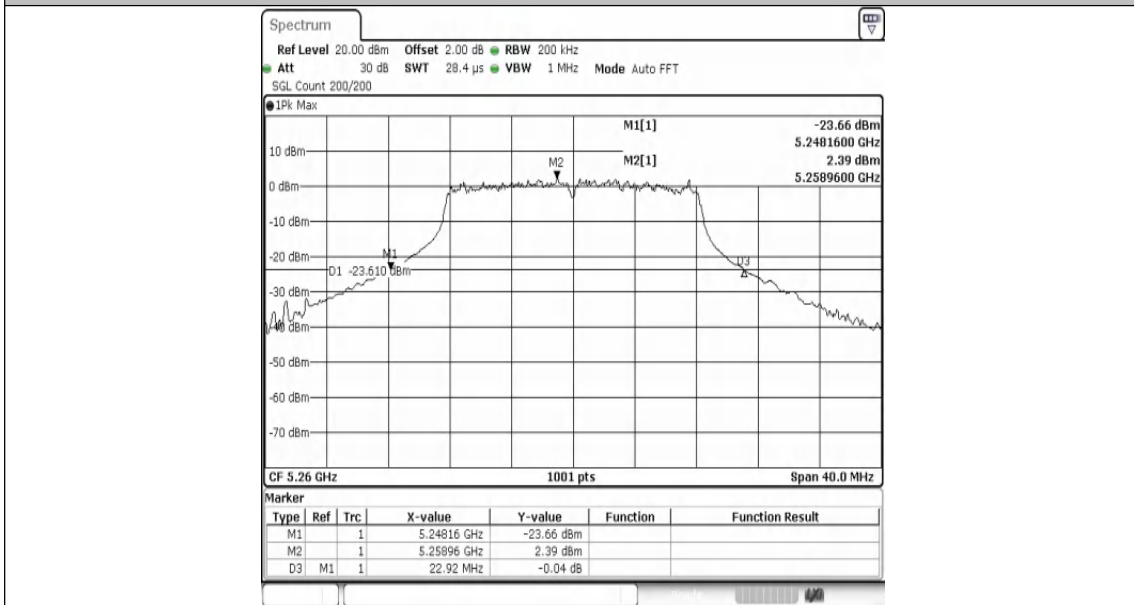


11A-Ant1-5260

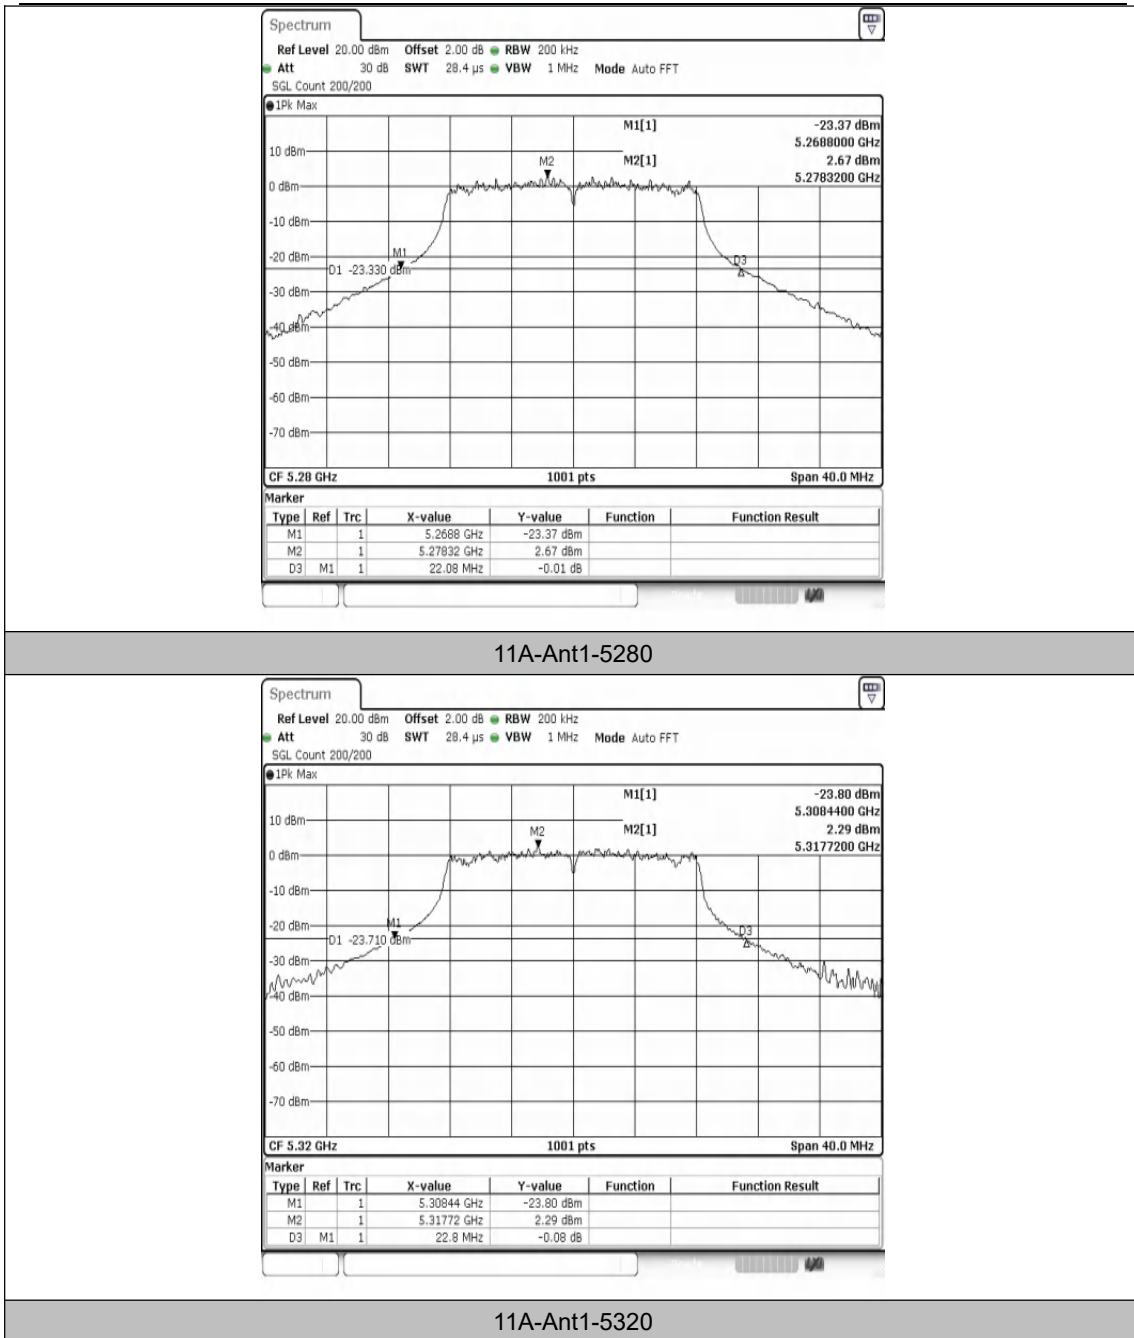




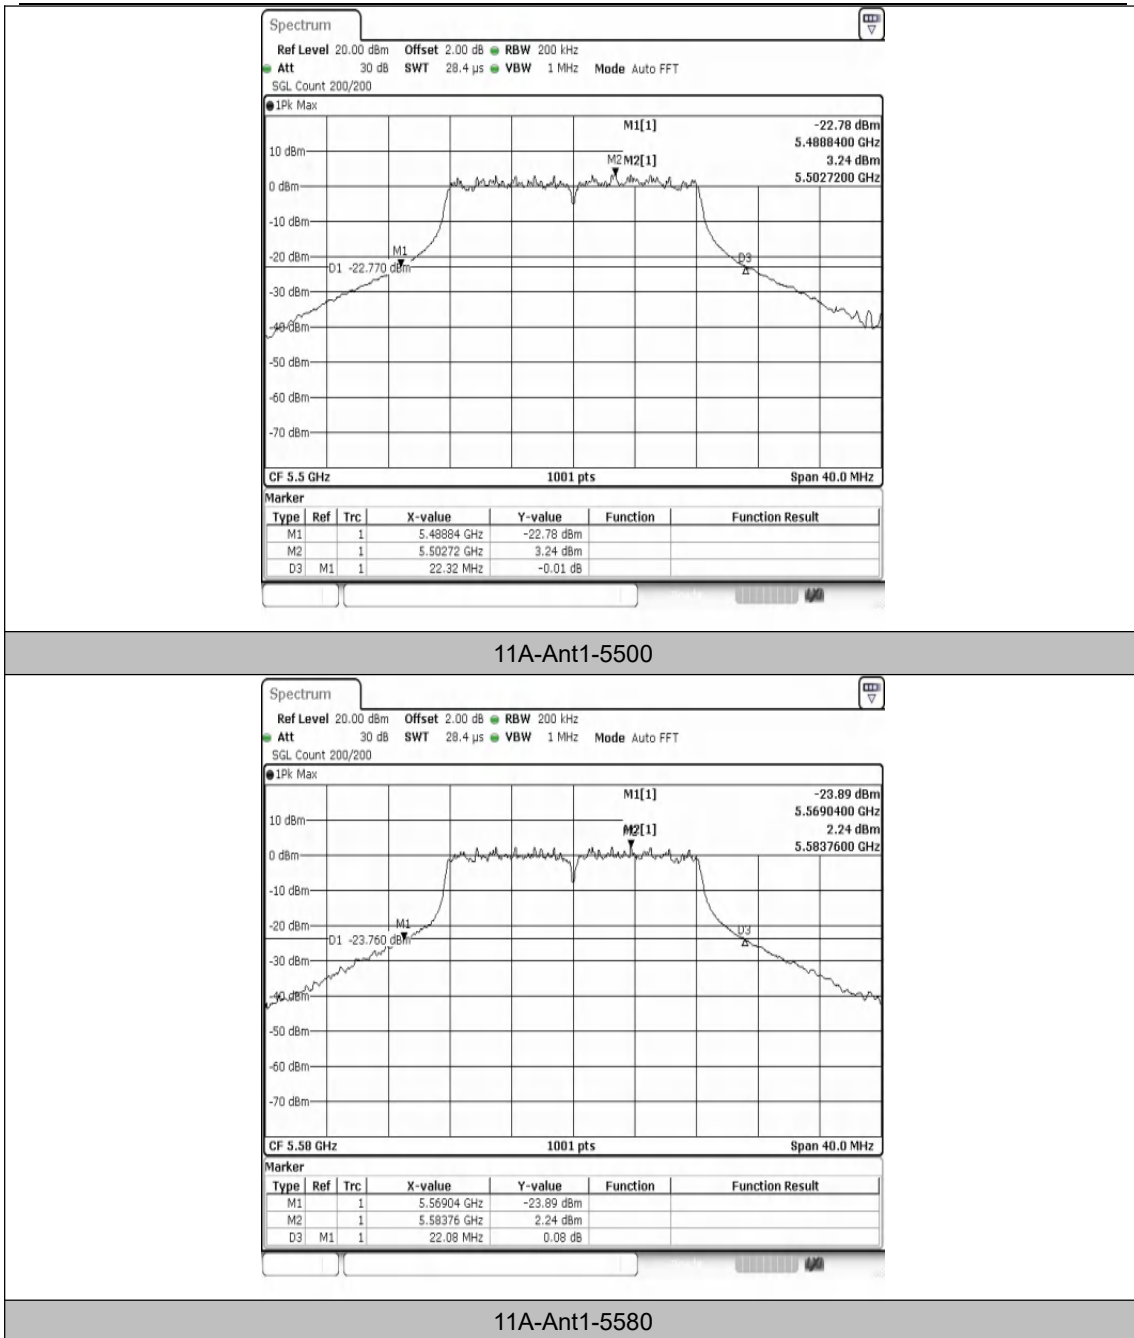

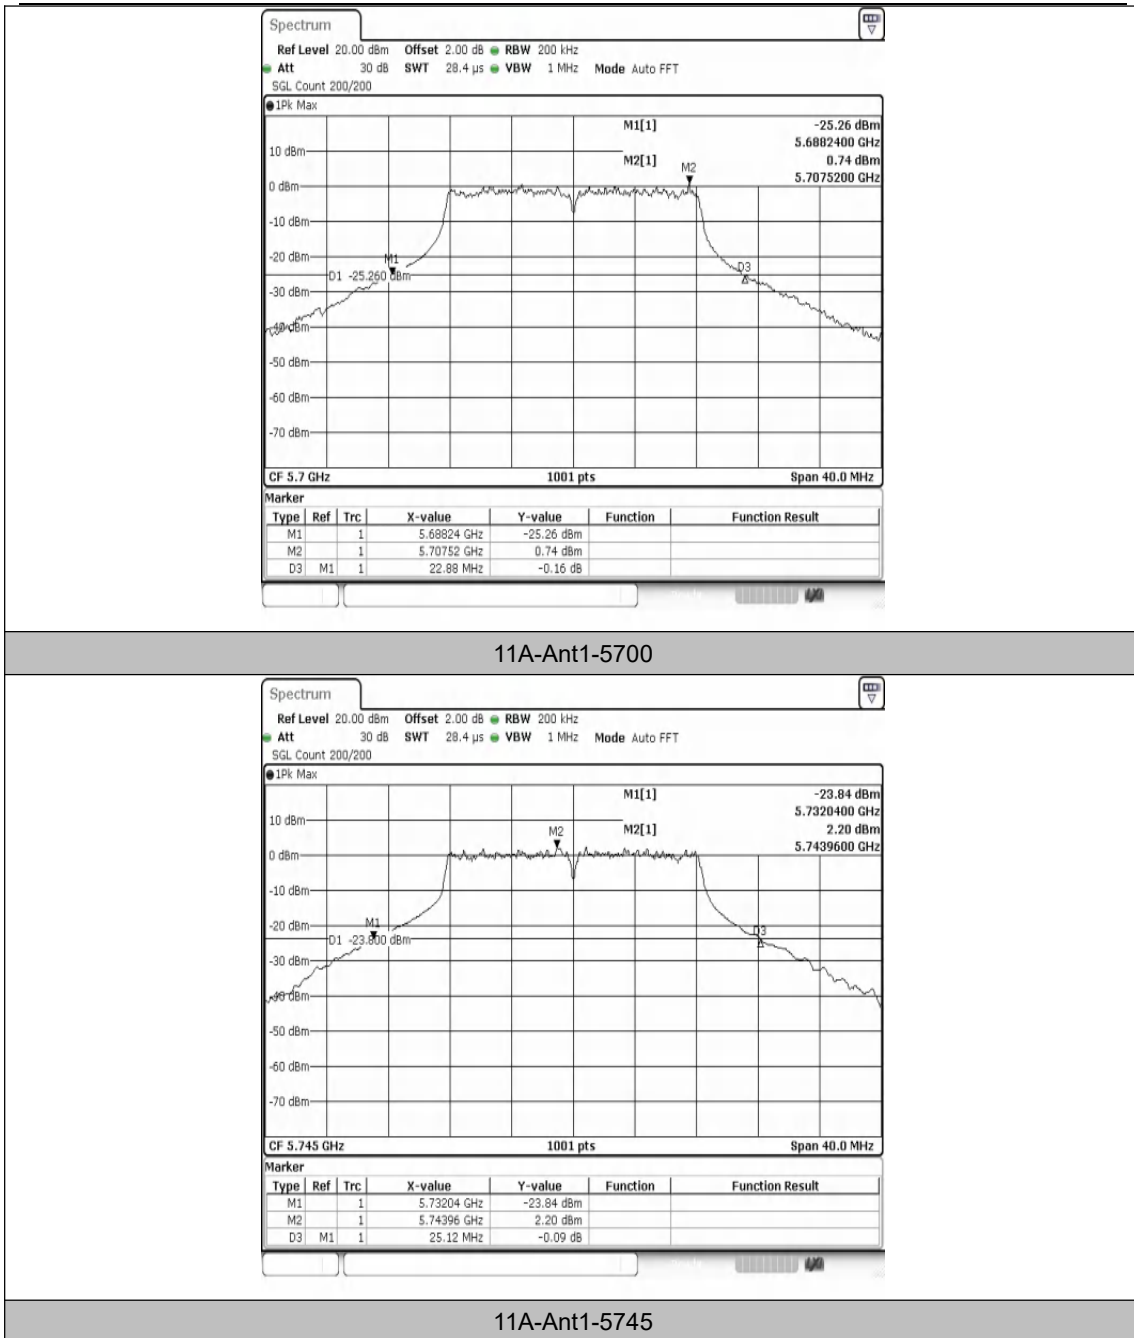




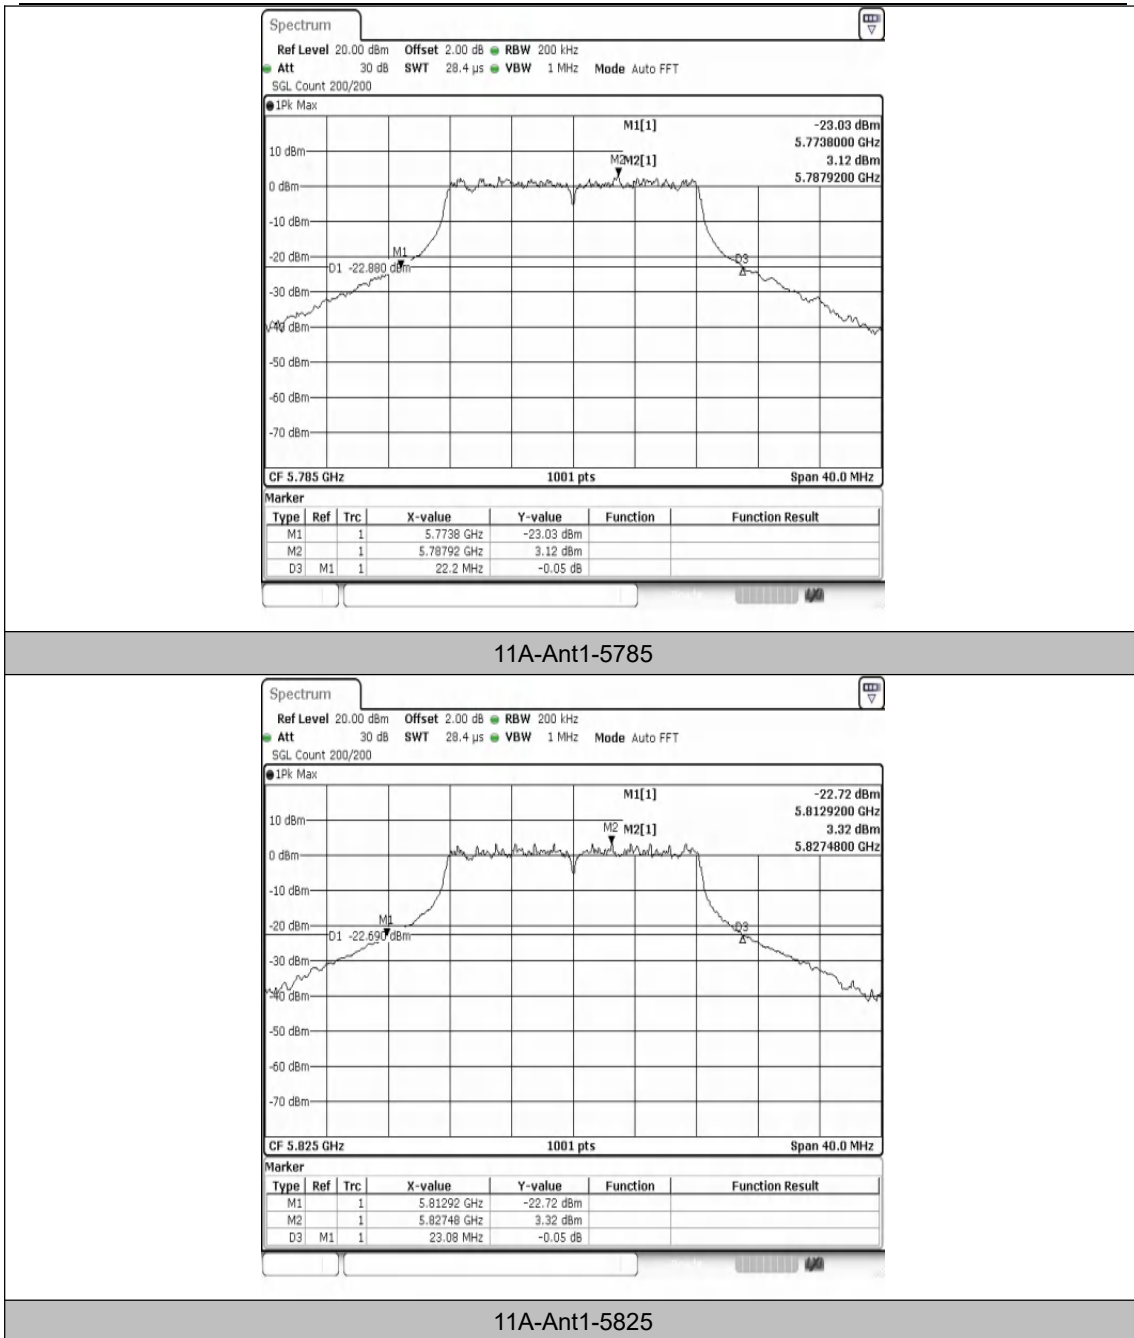



### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

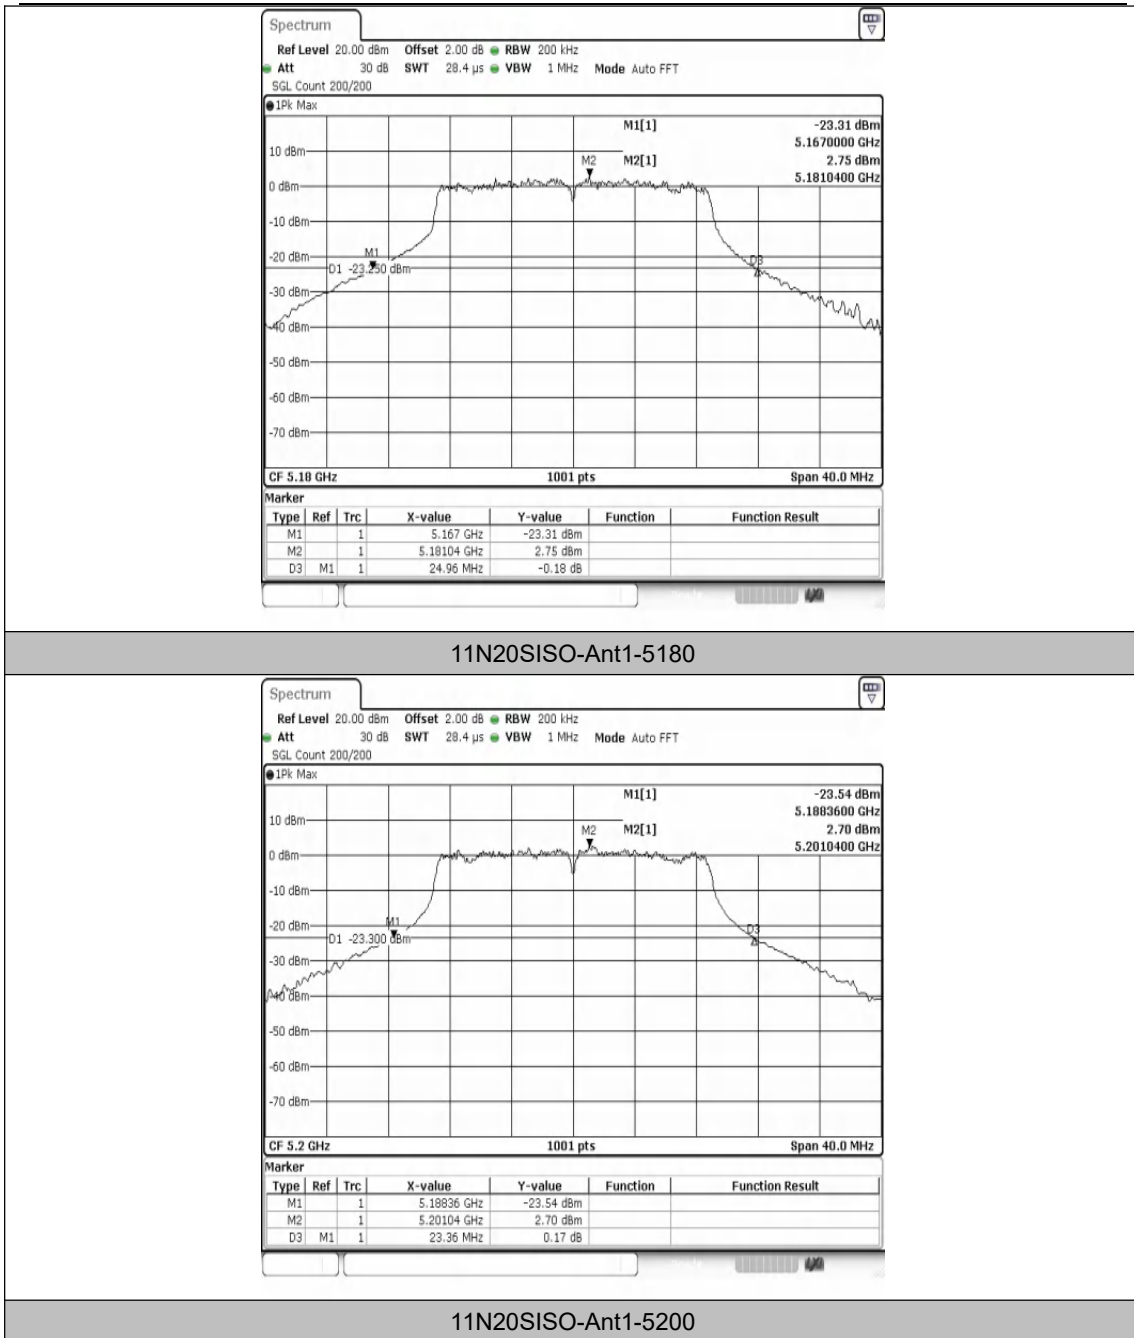

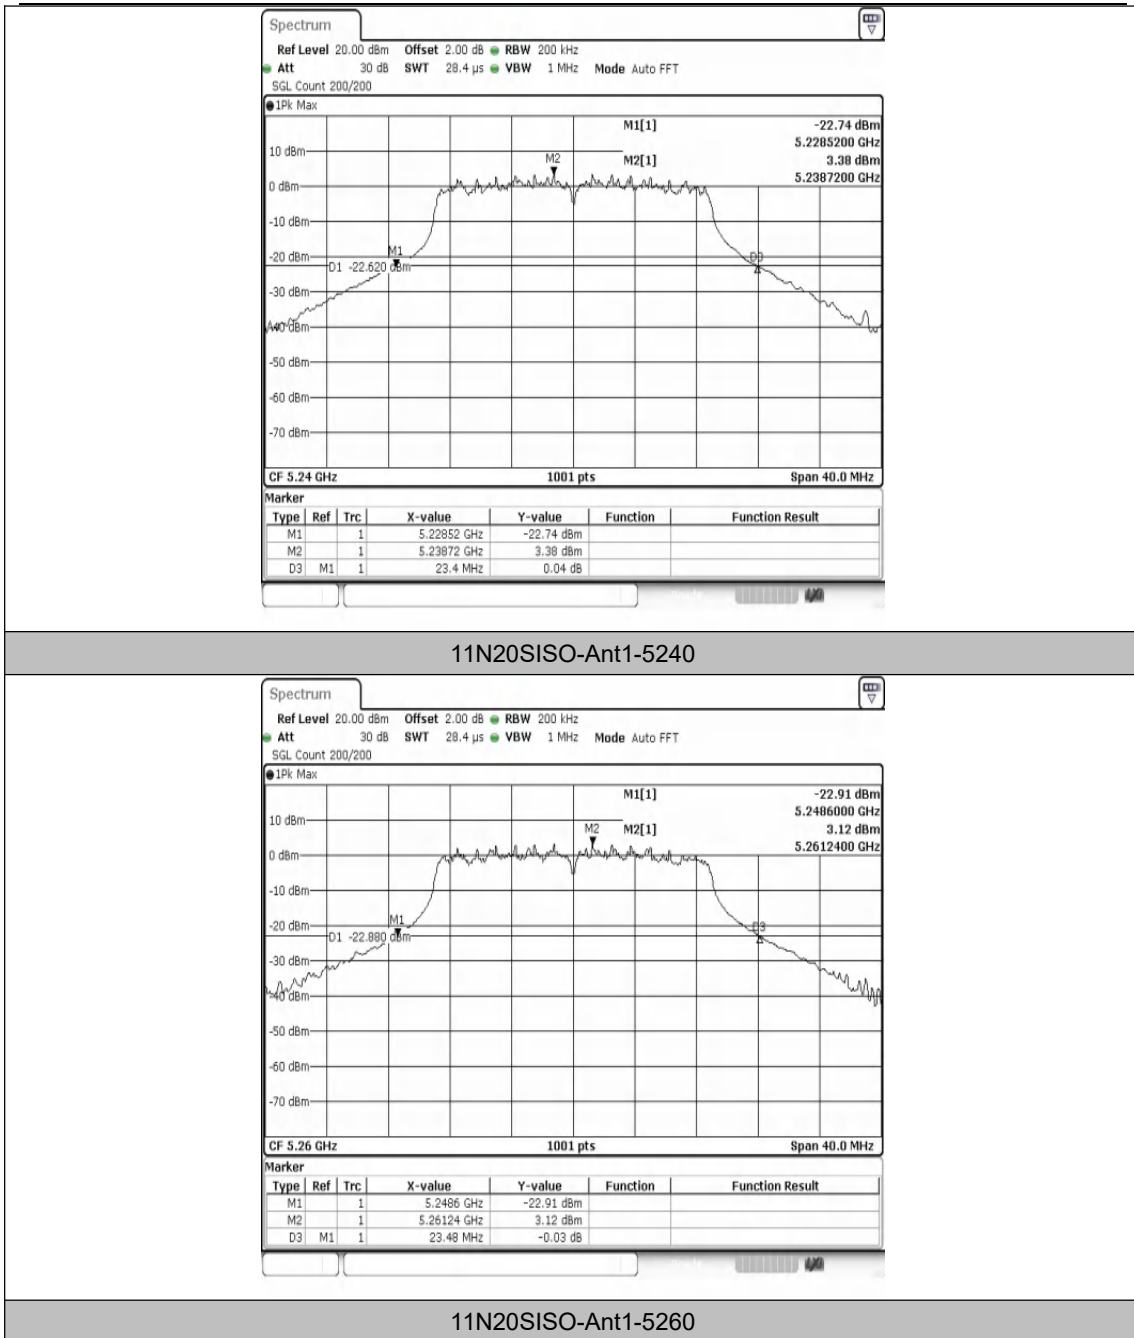


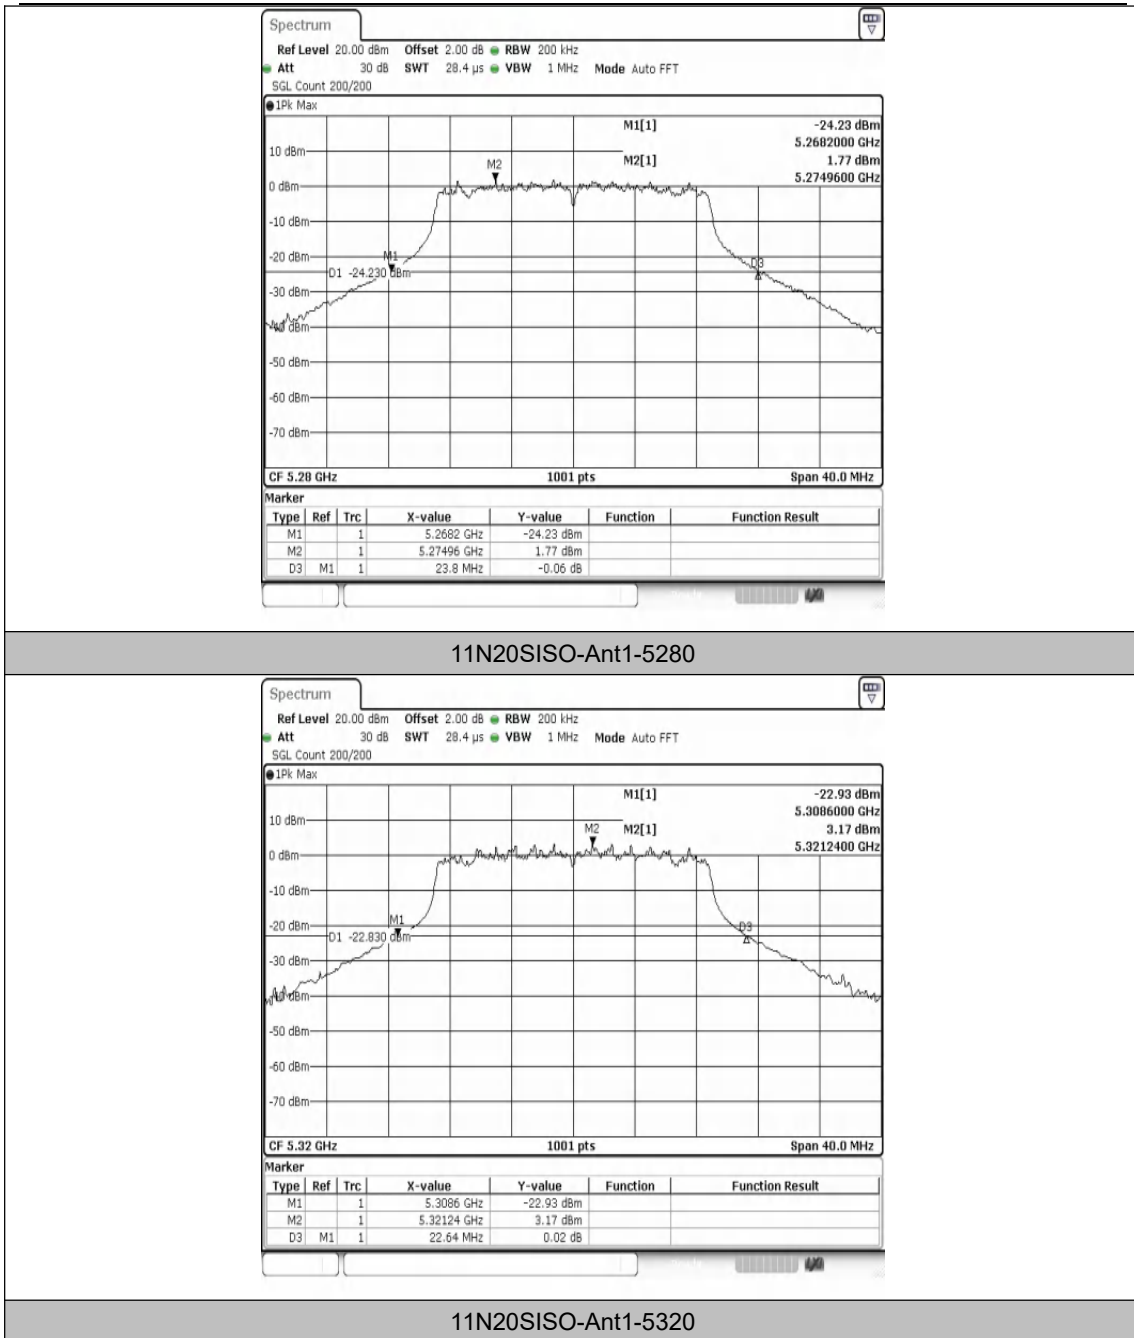


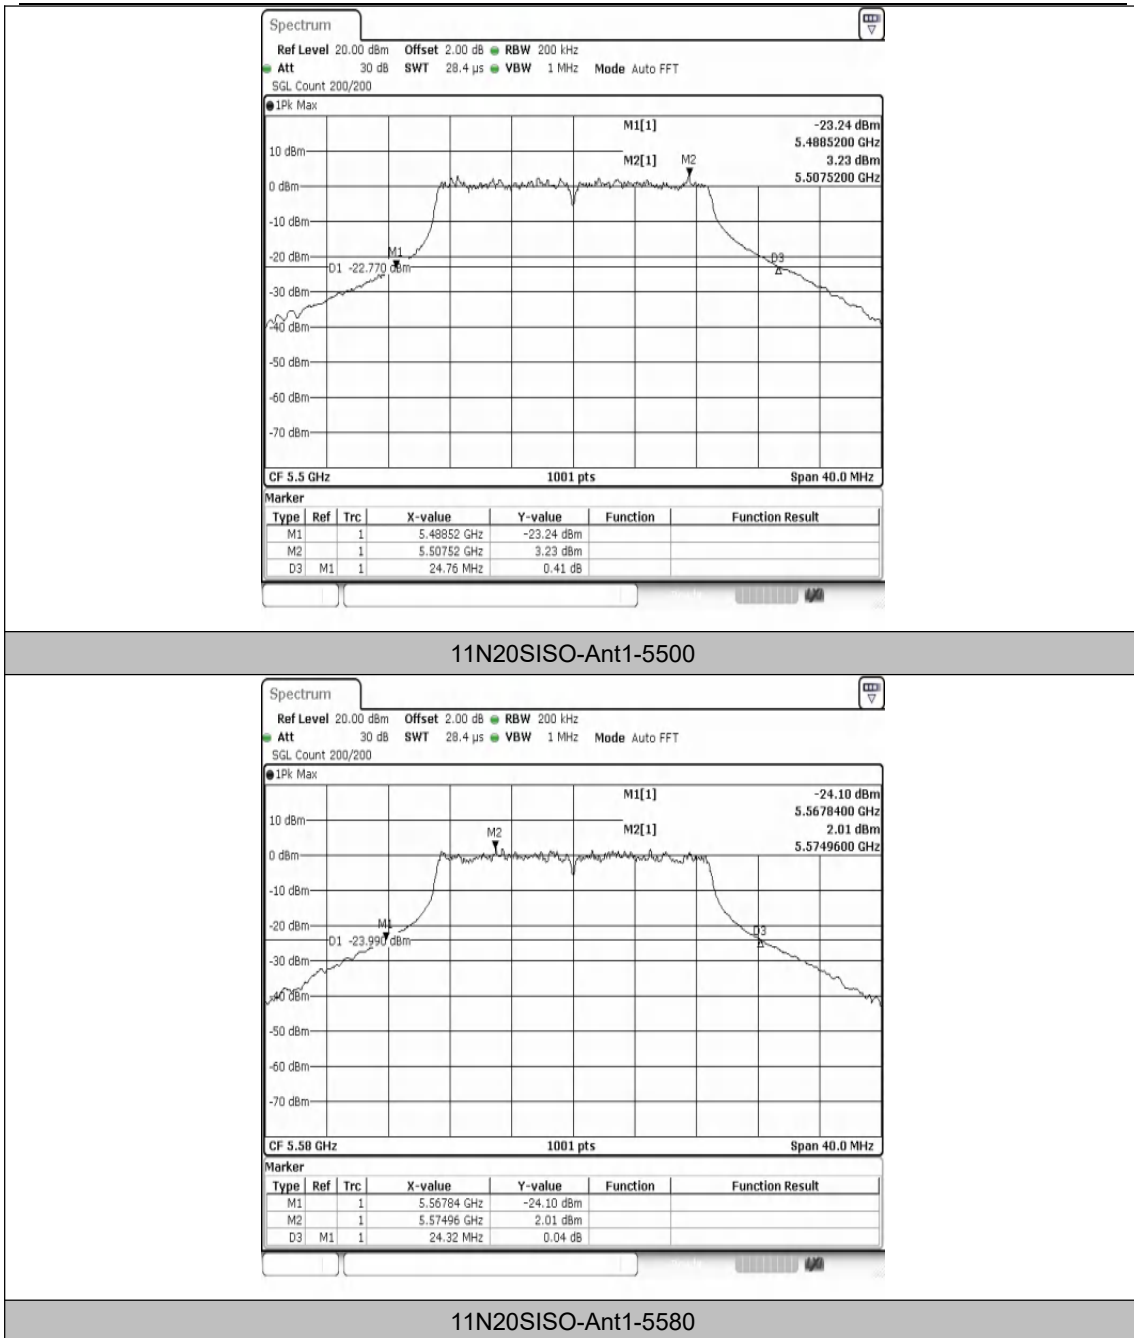


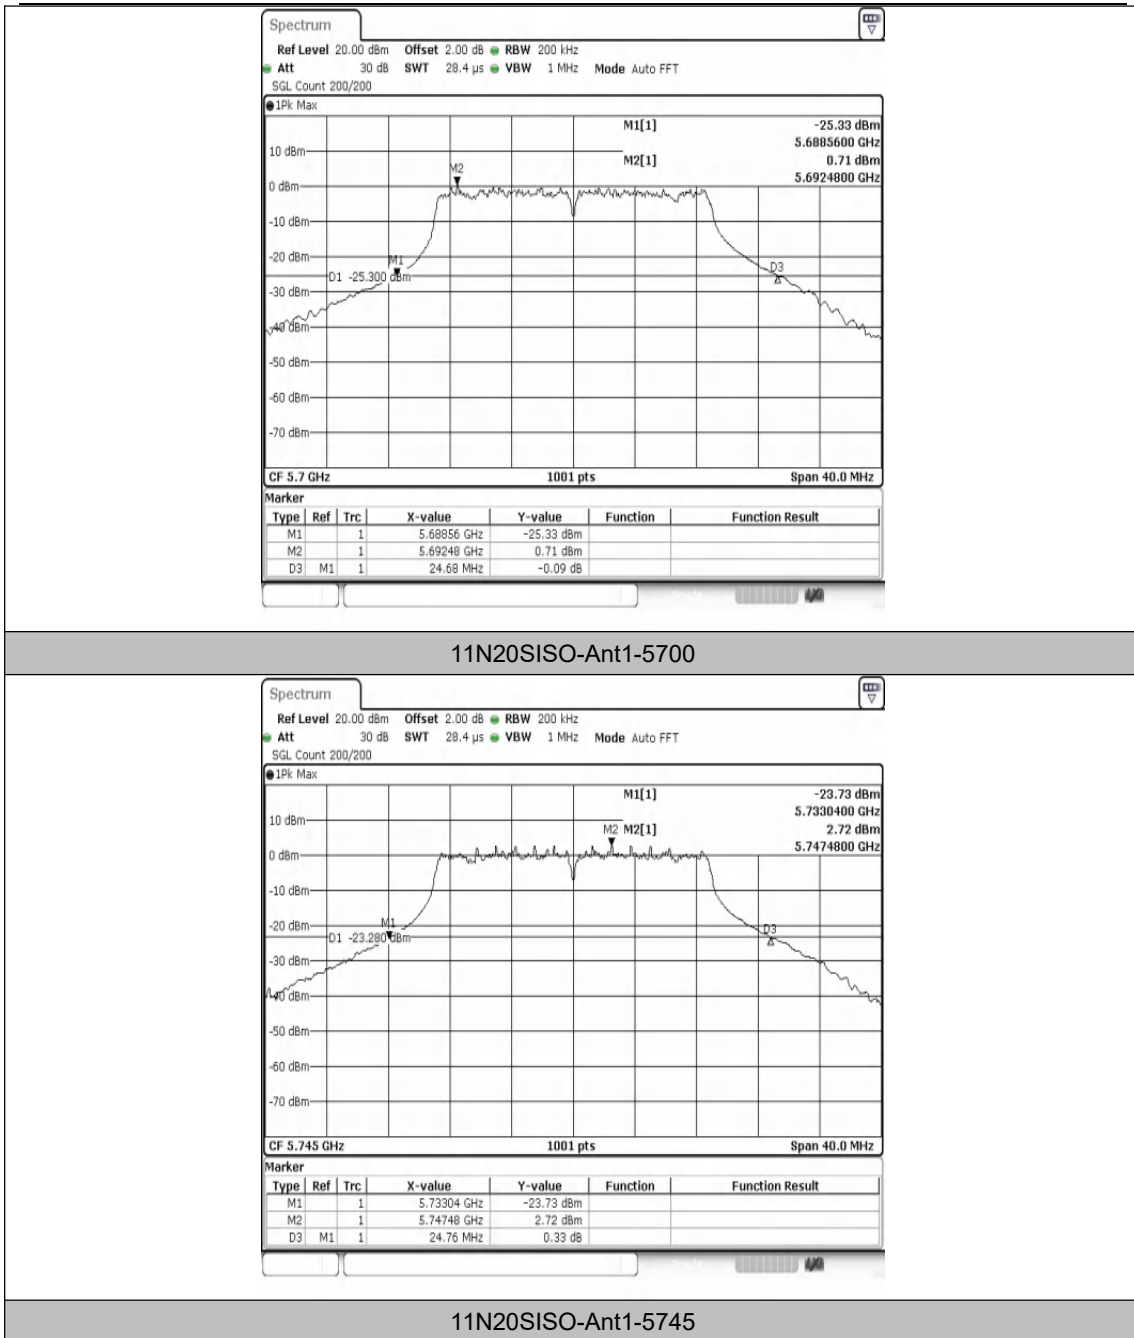



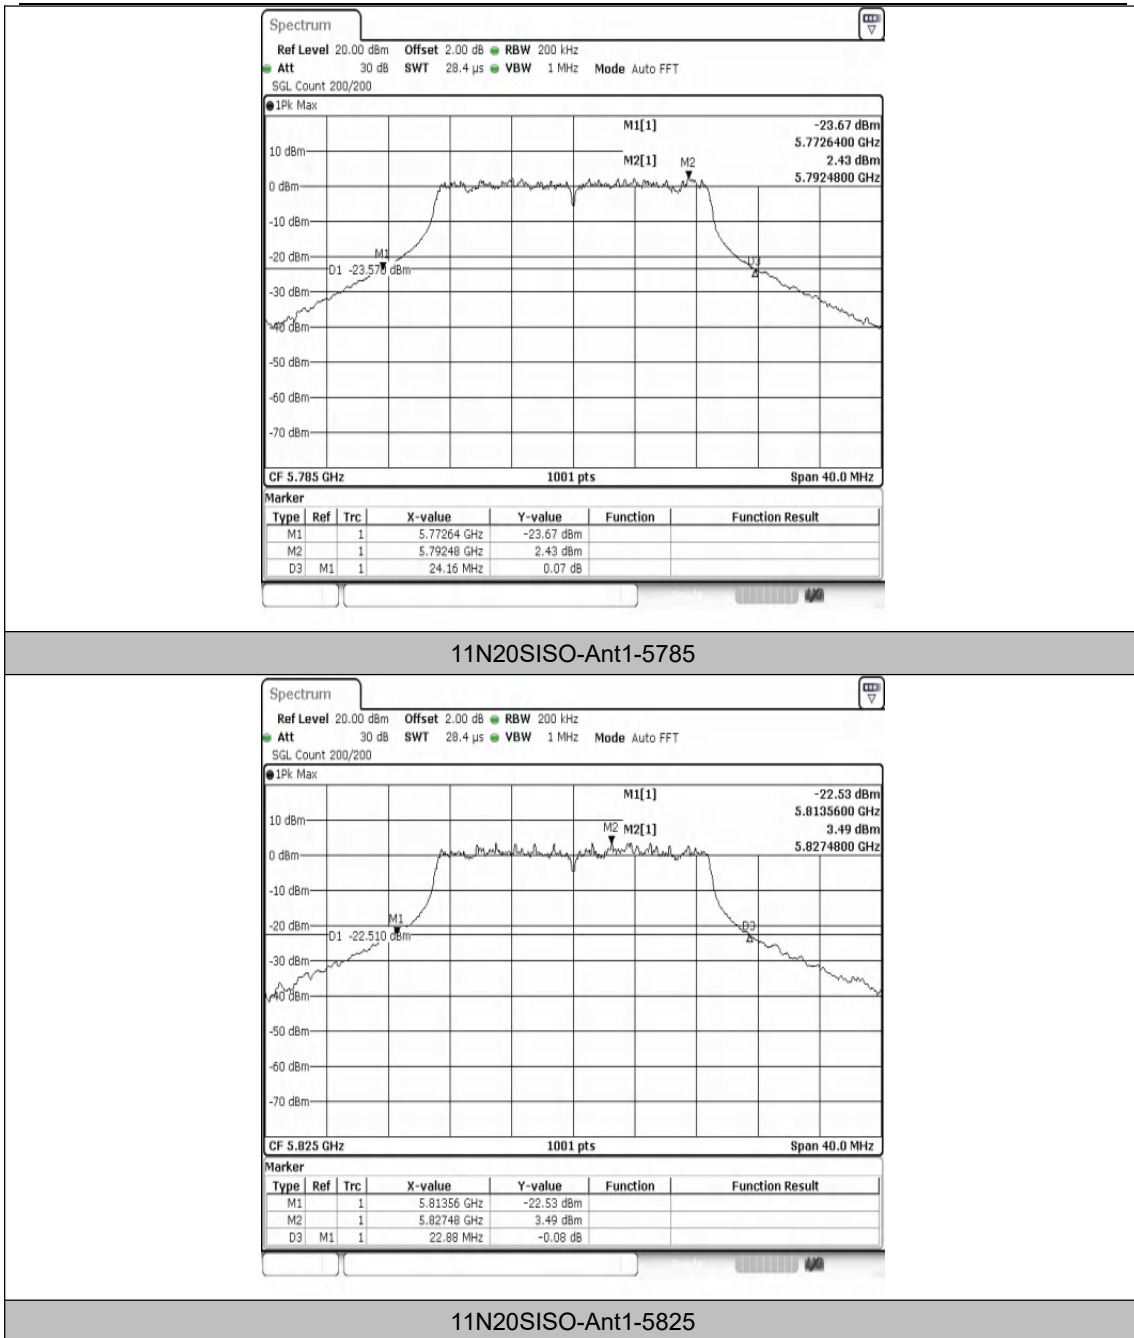

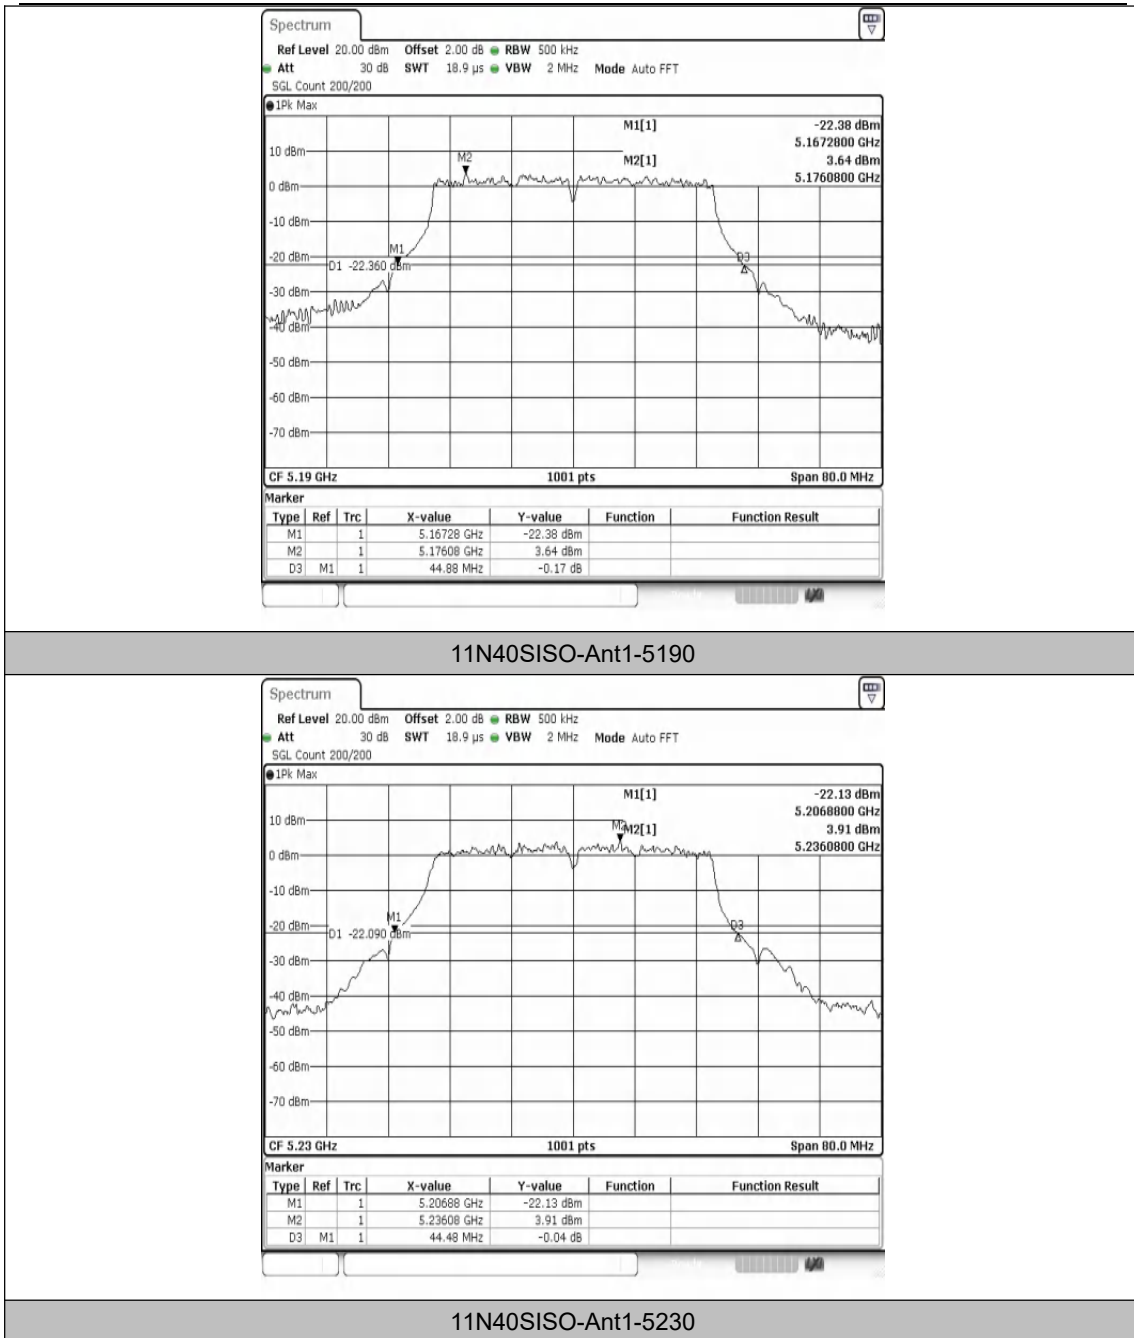


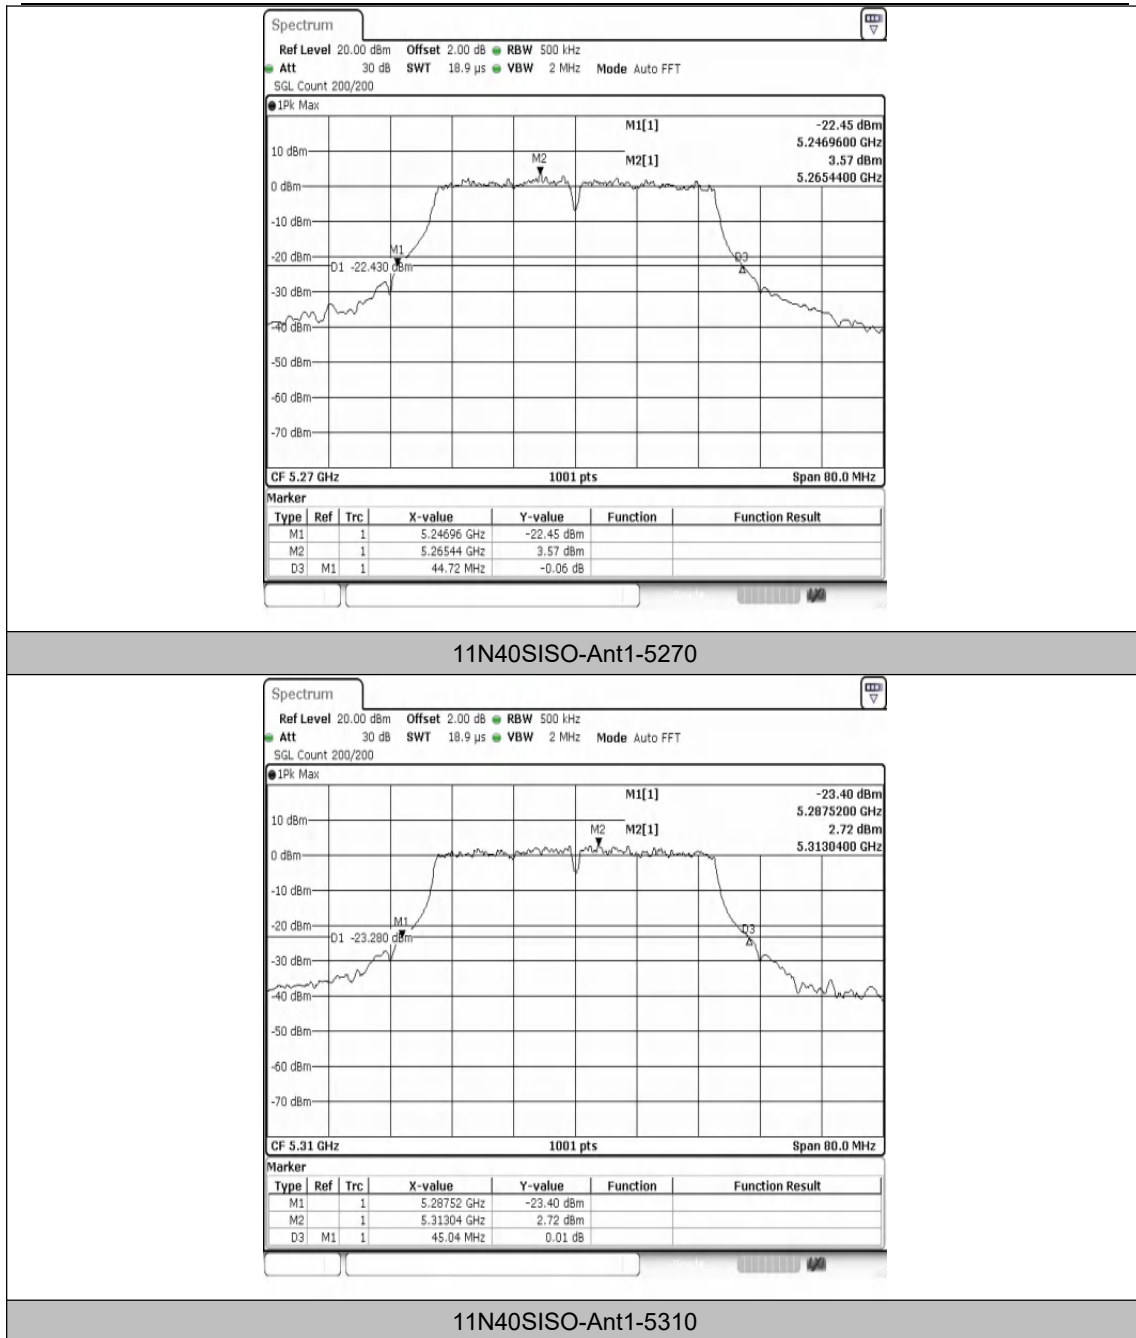

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

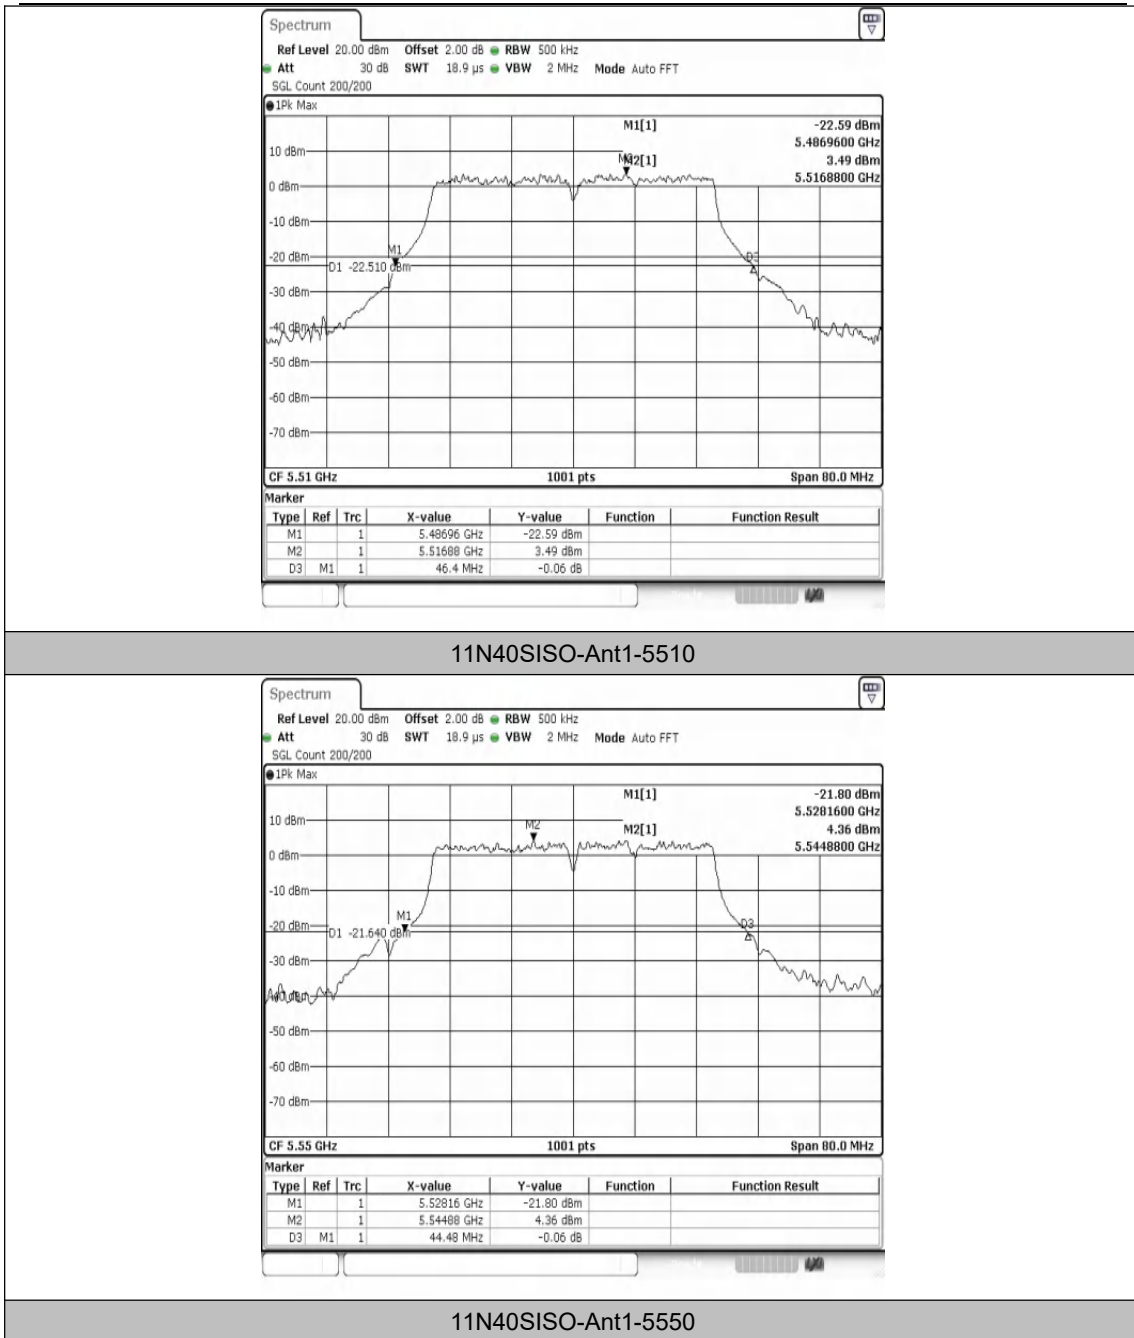


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

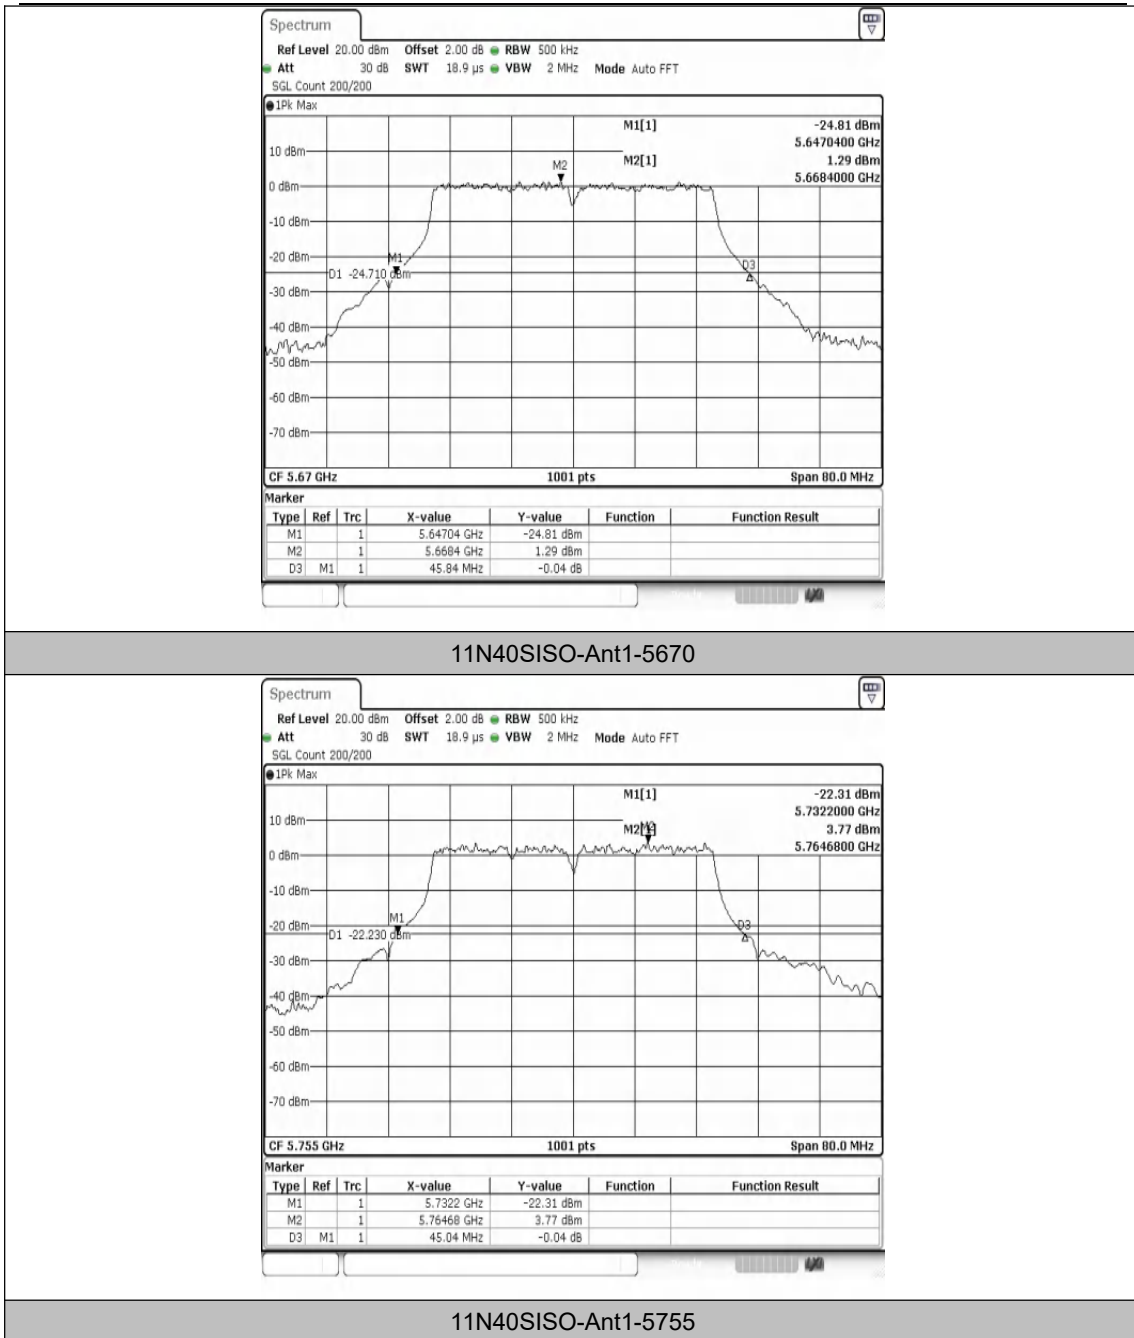

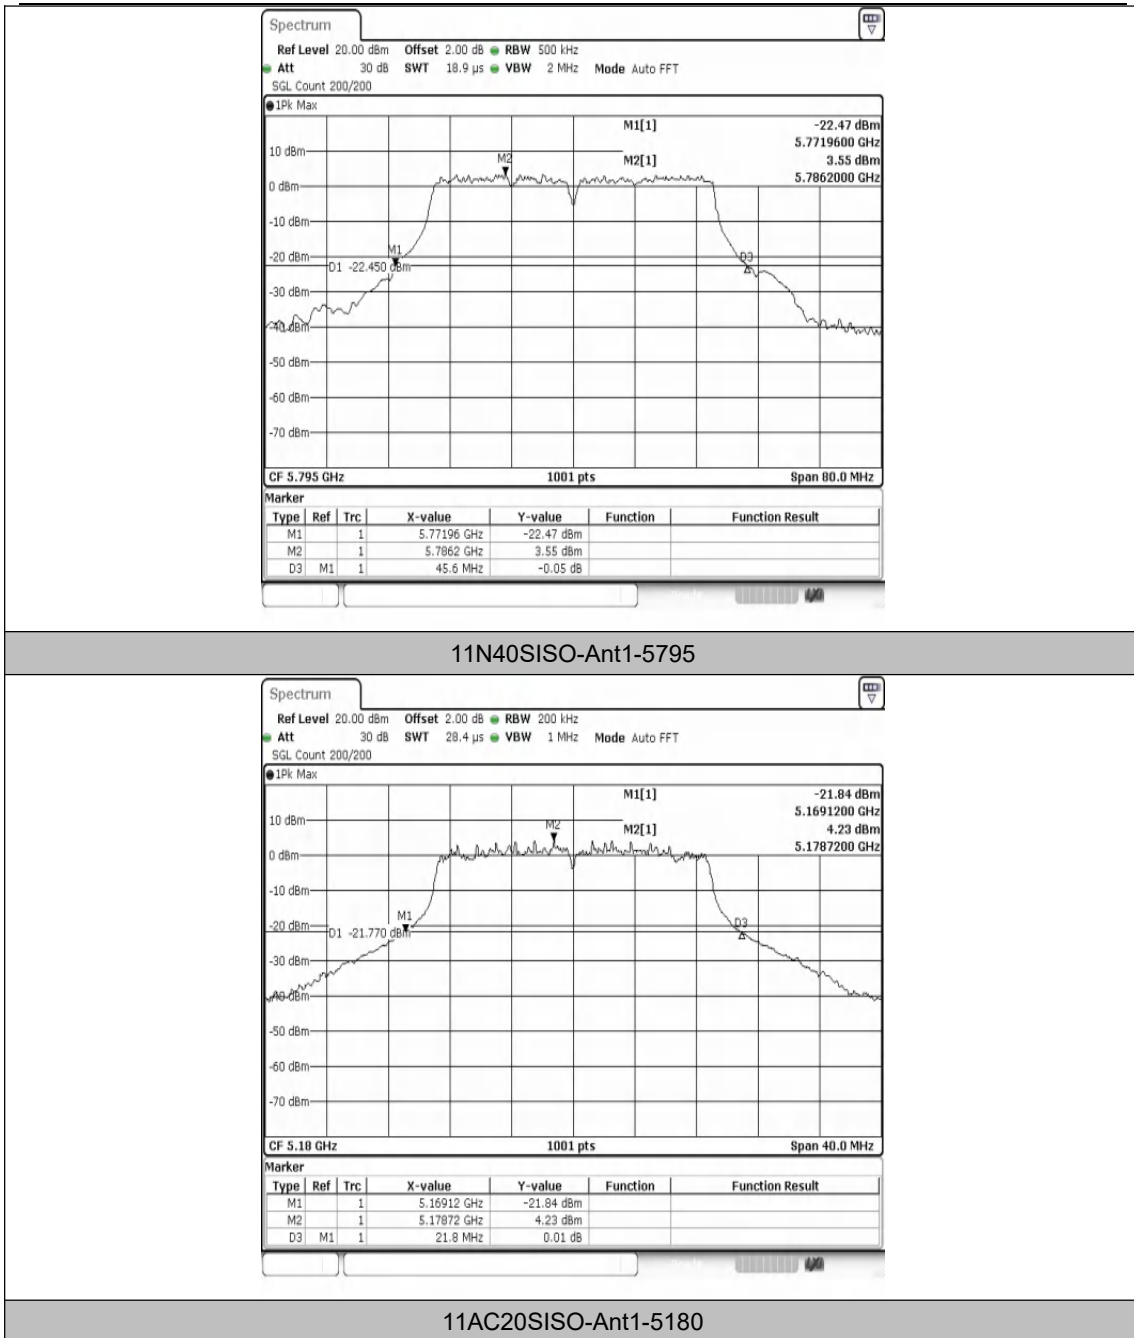



### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



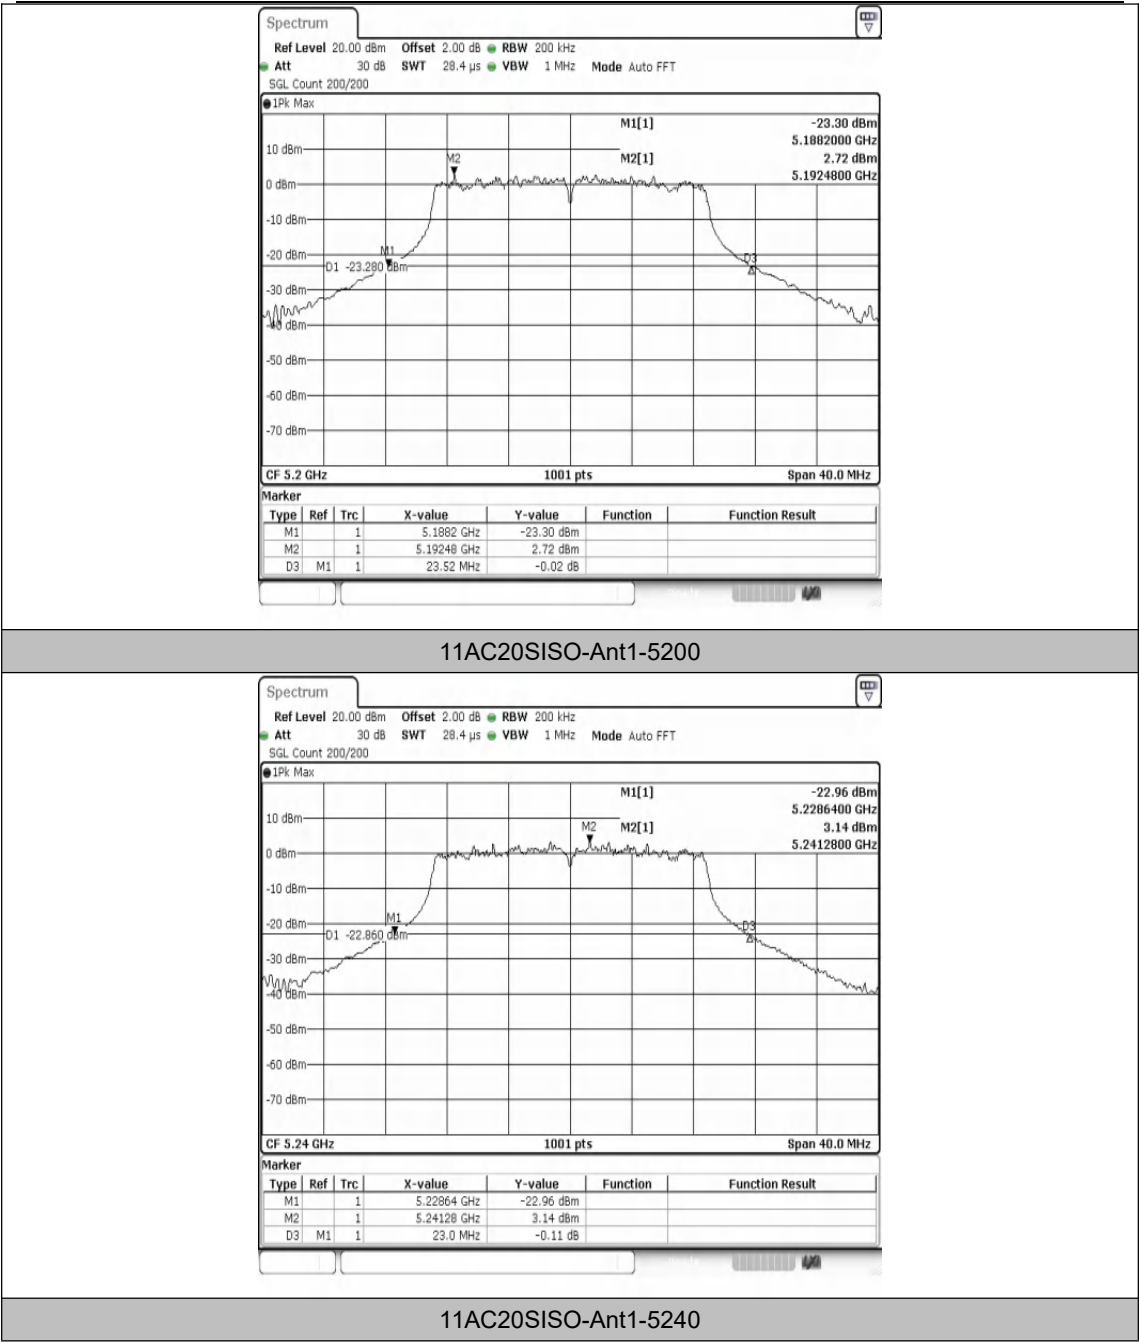

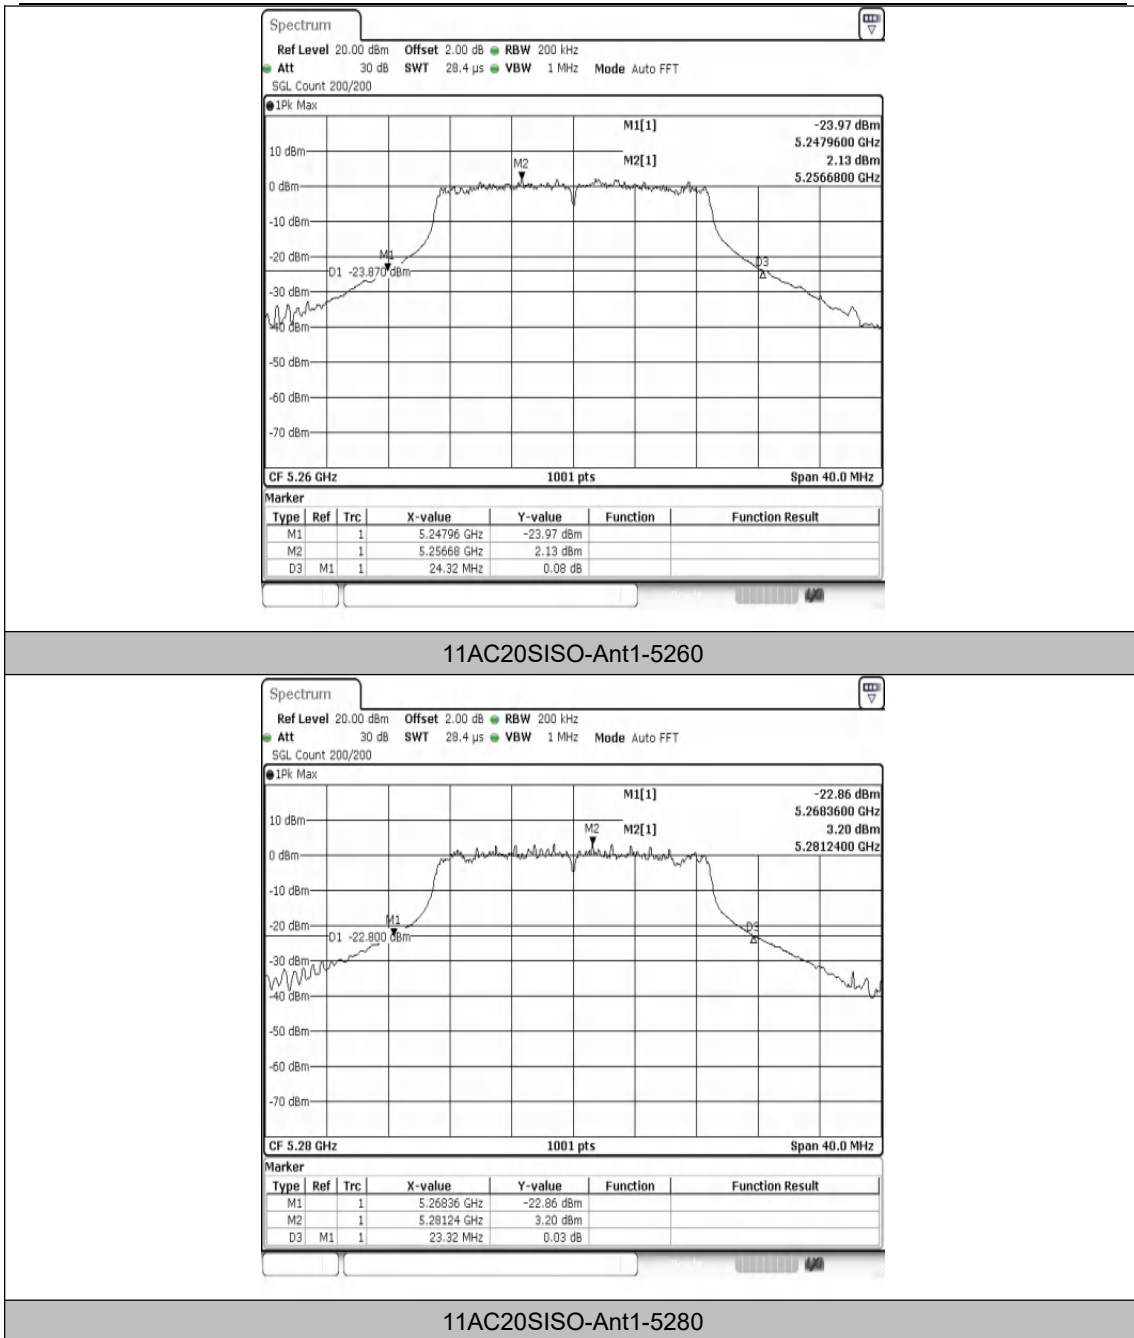


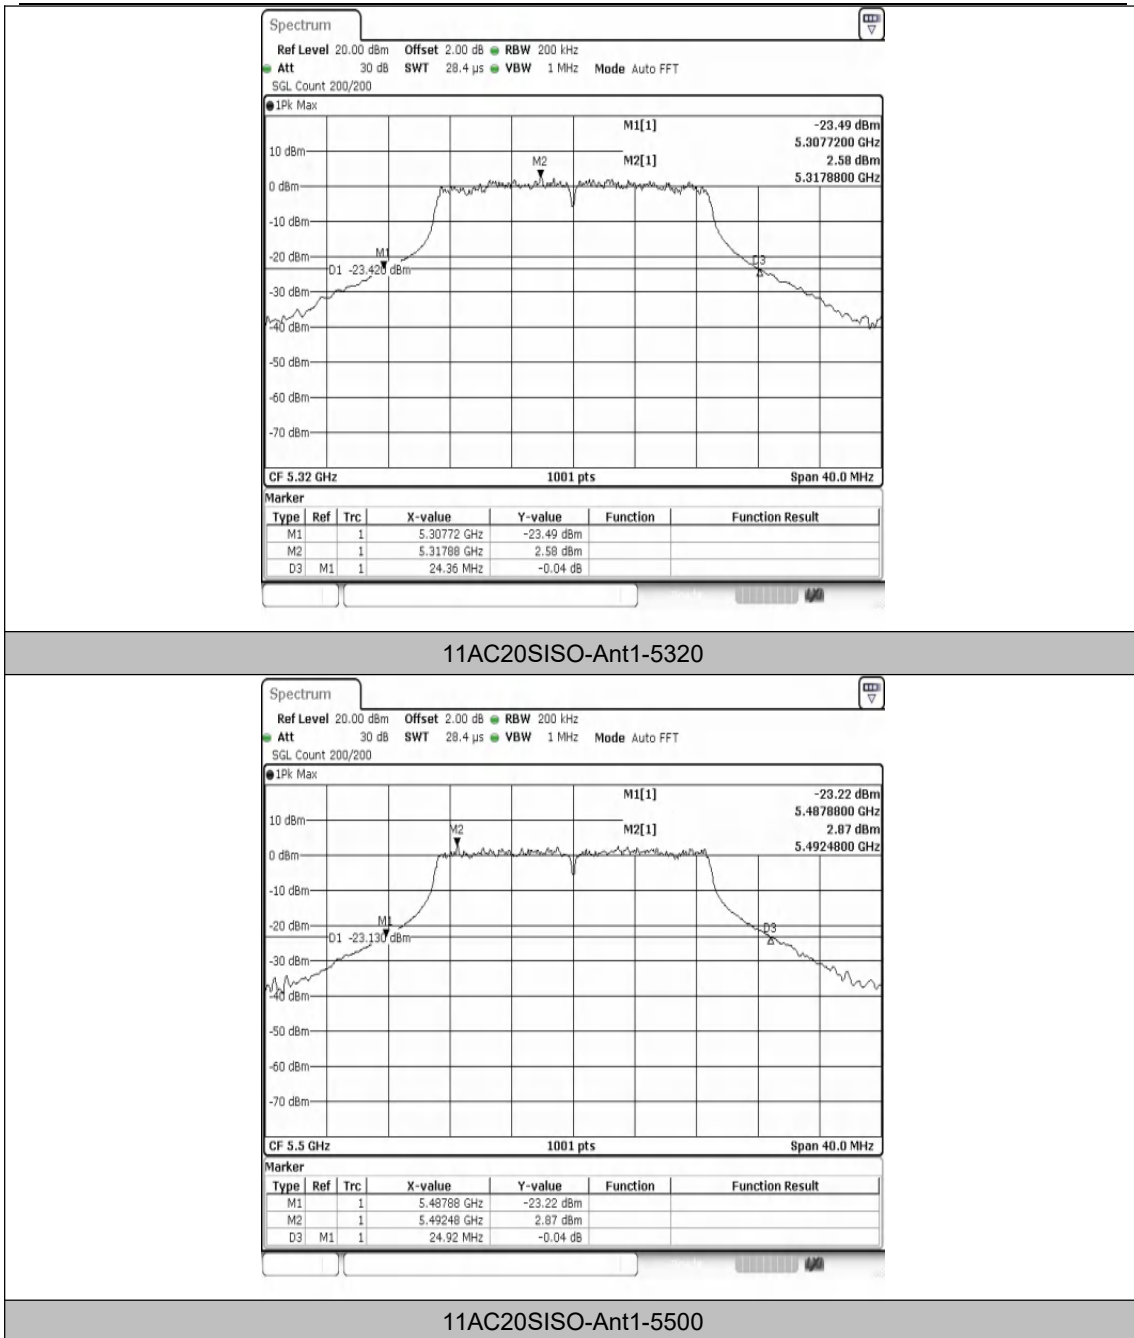


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

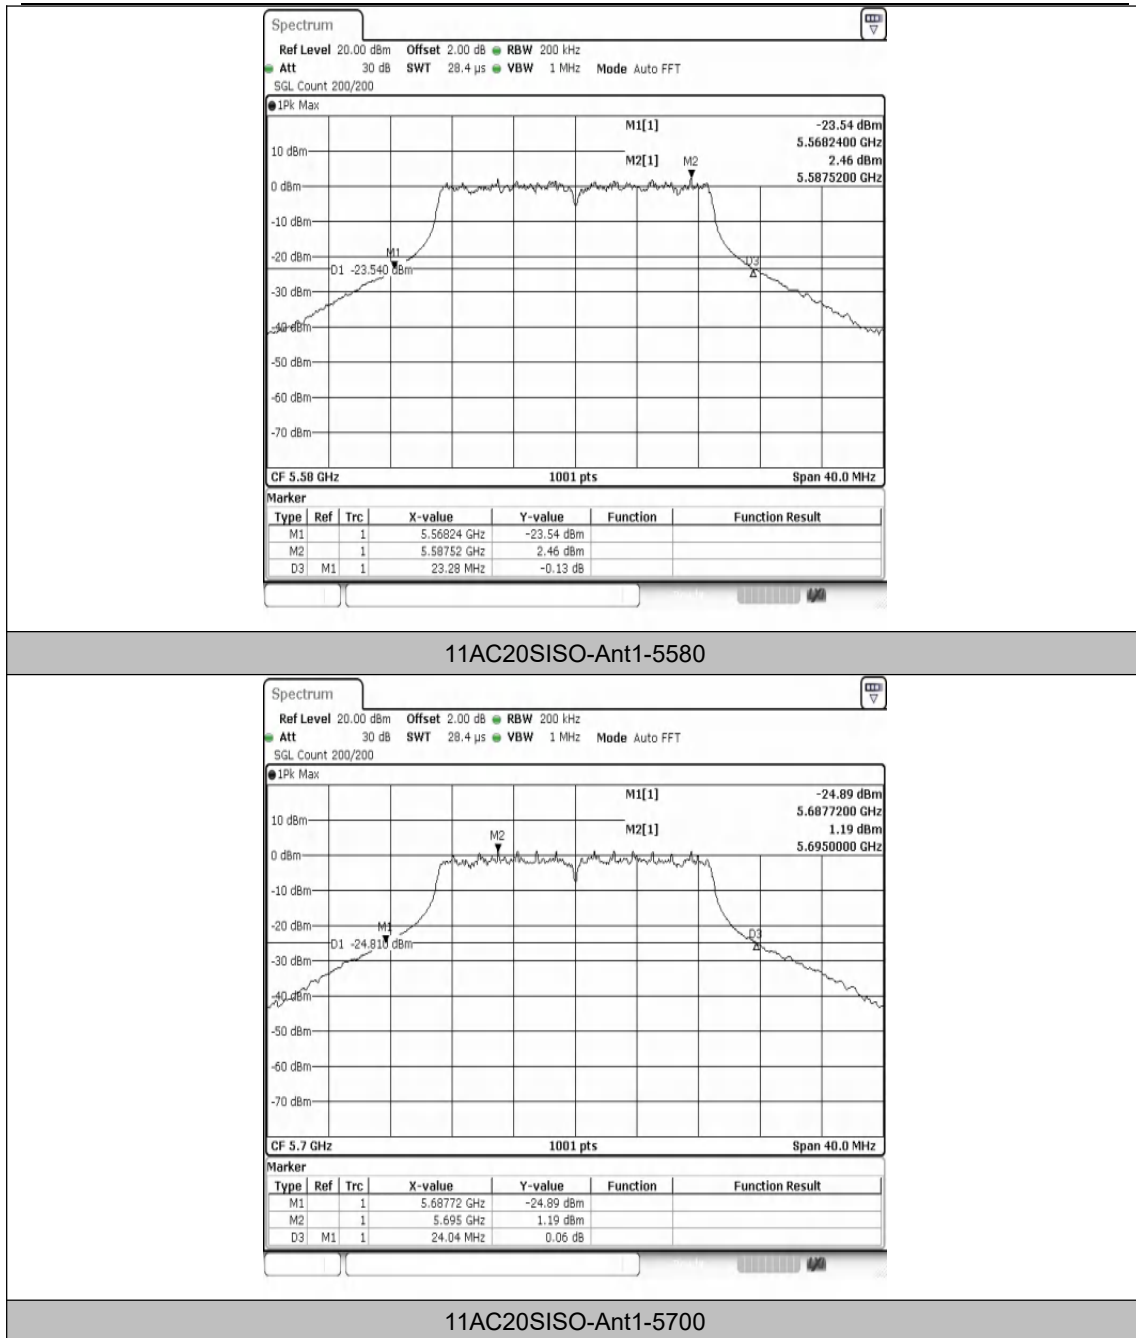


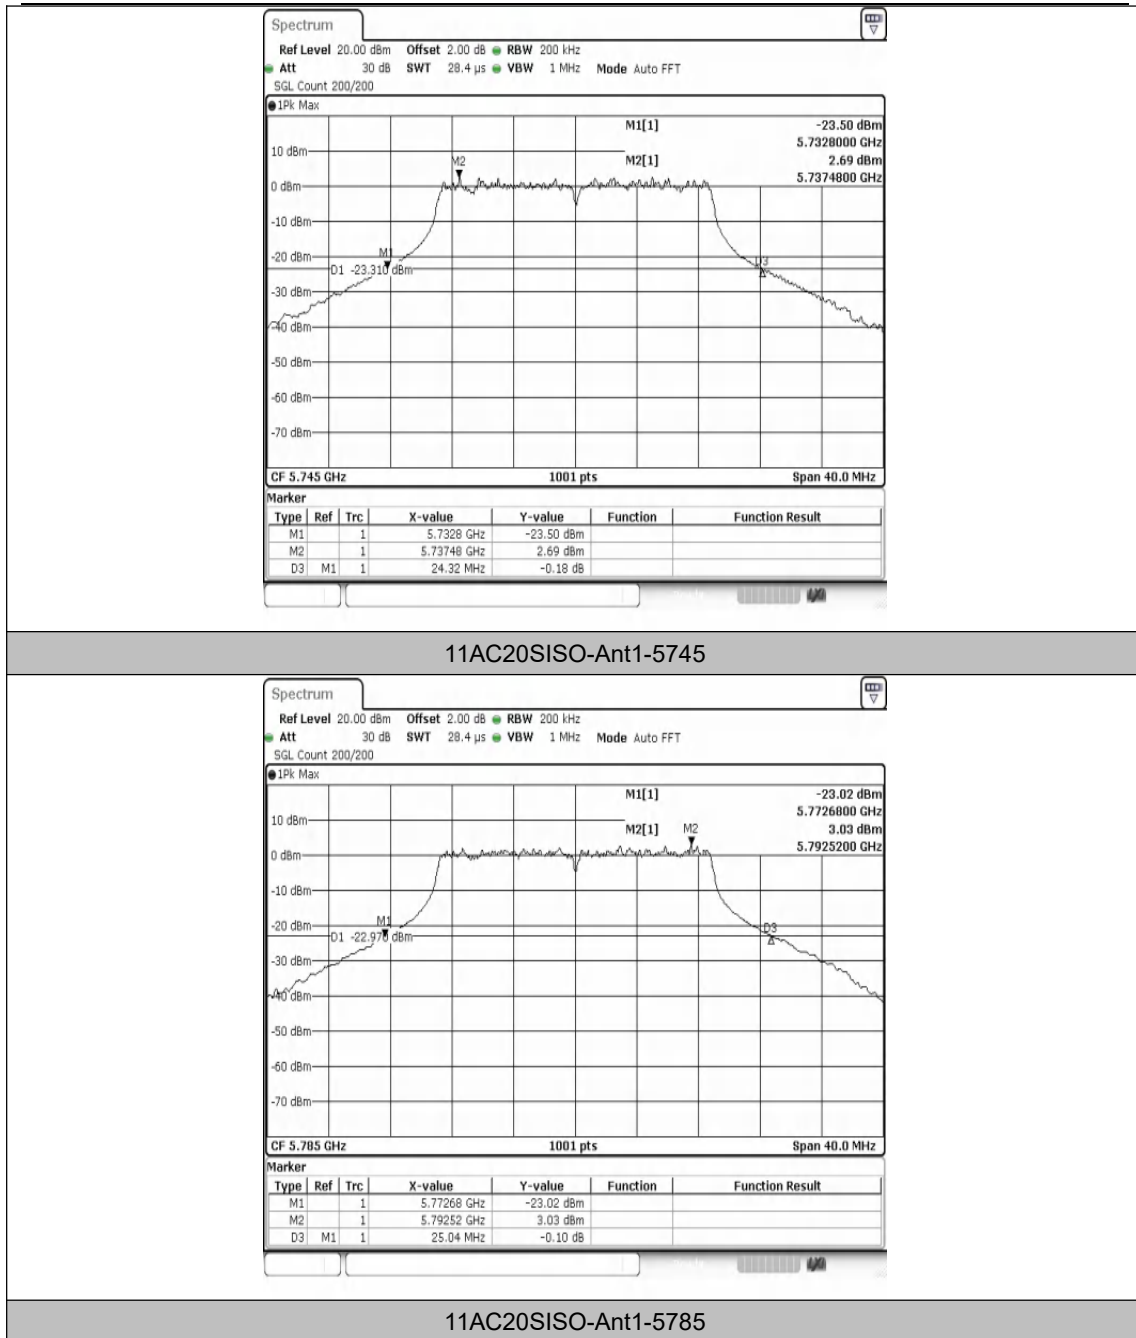


#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

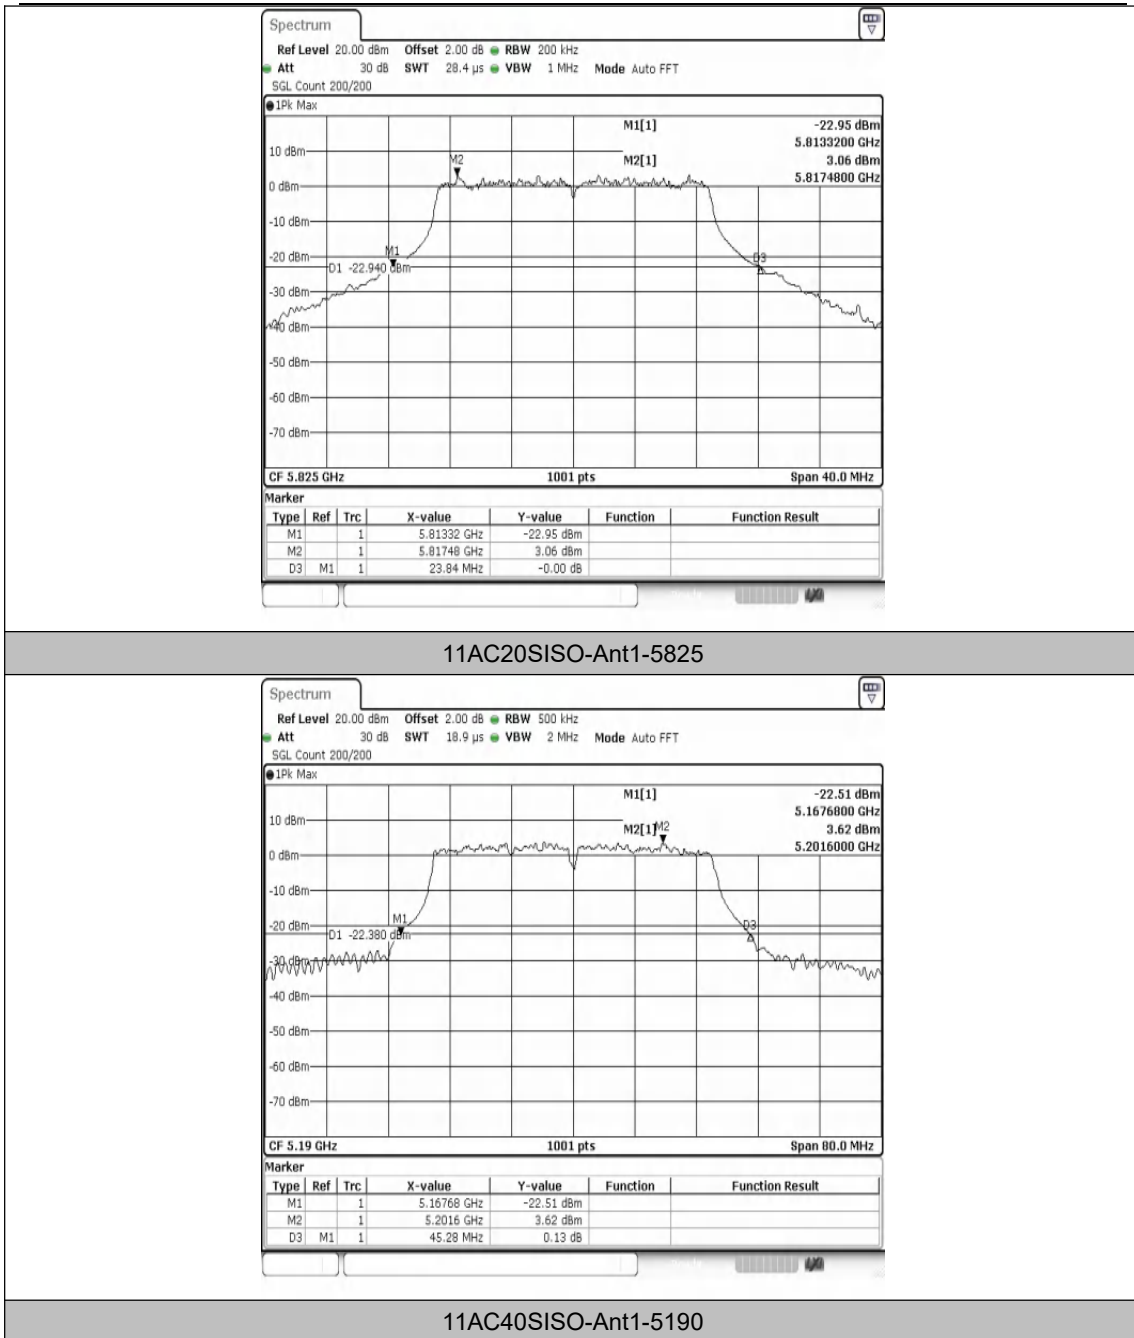




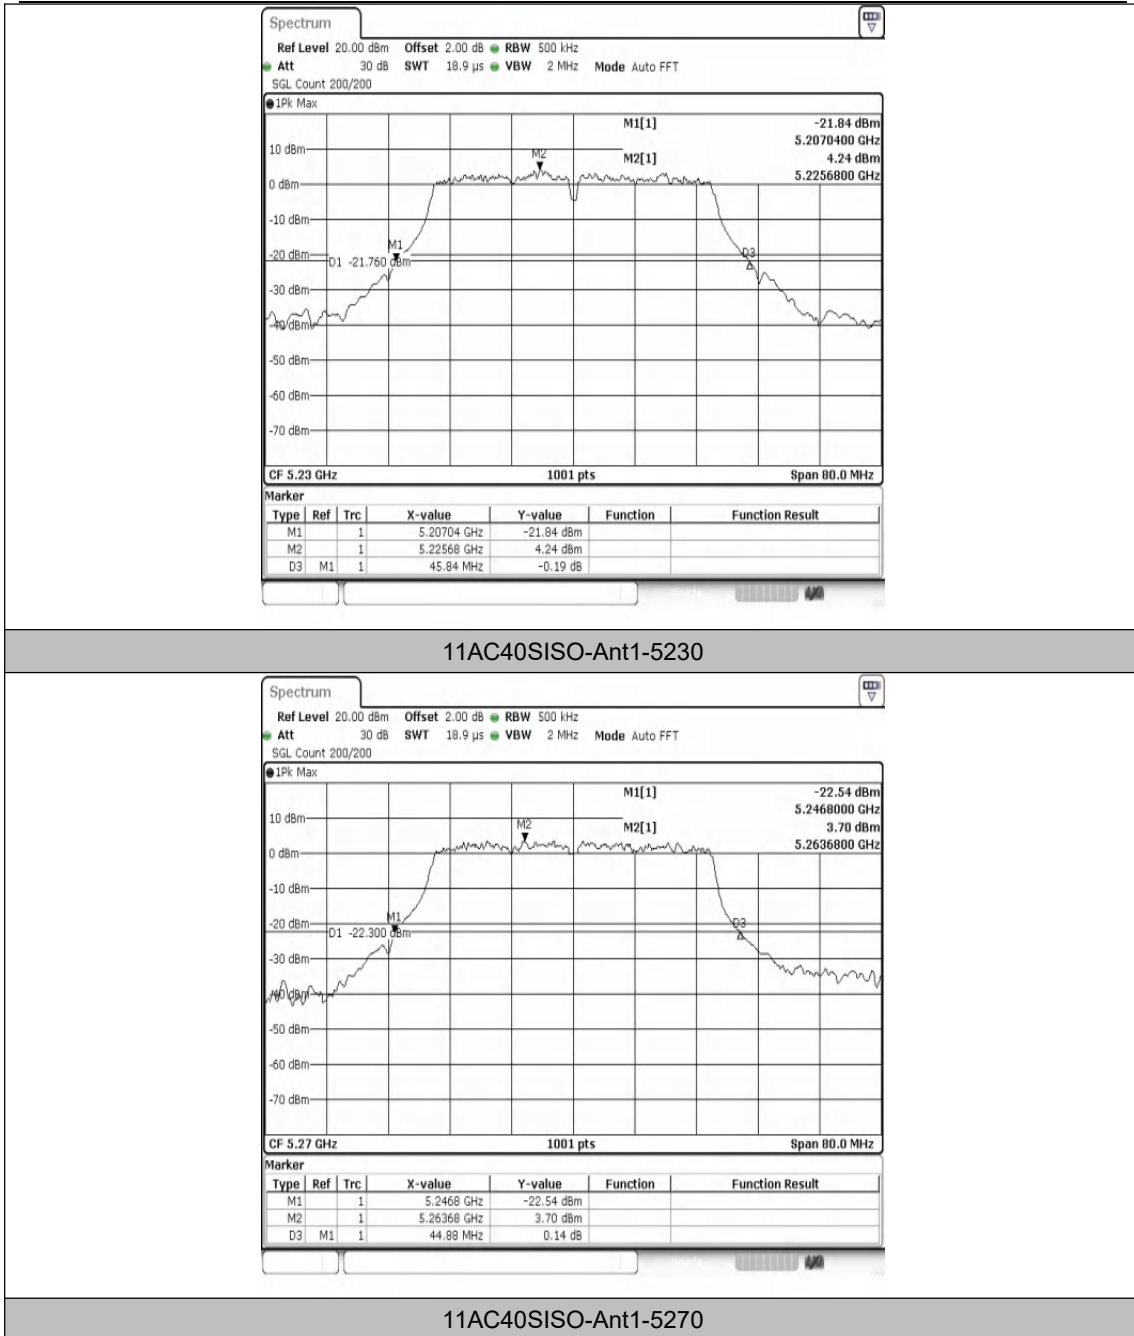

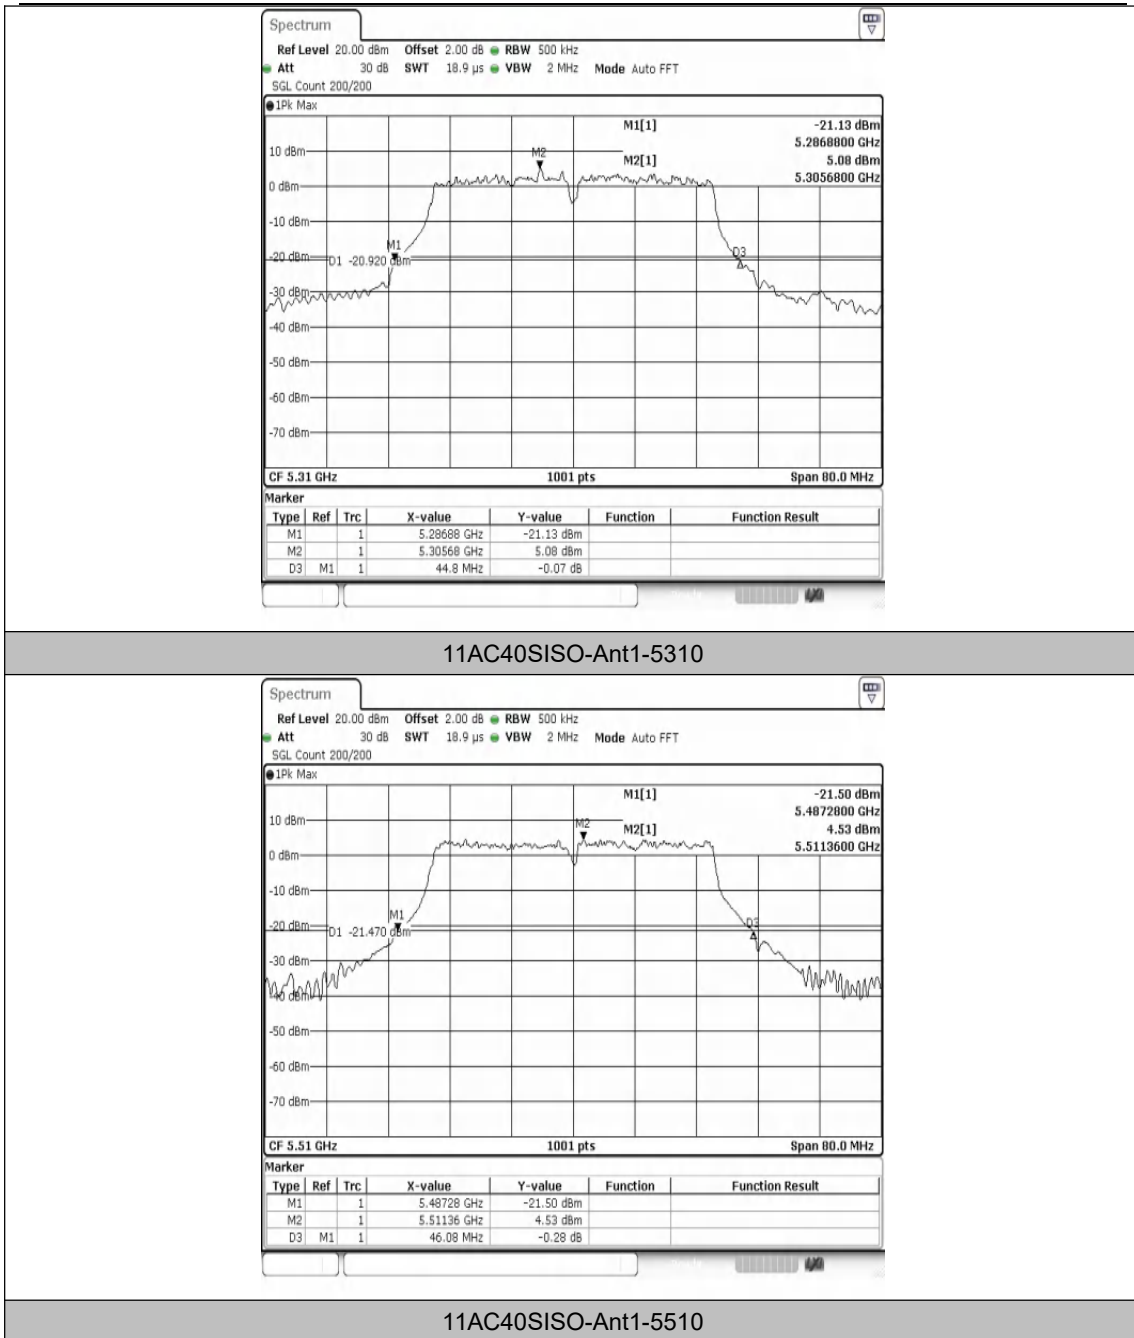

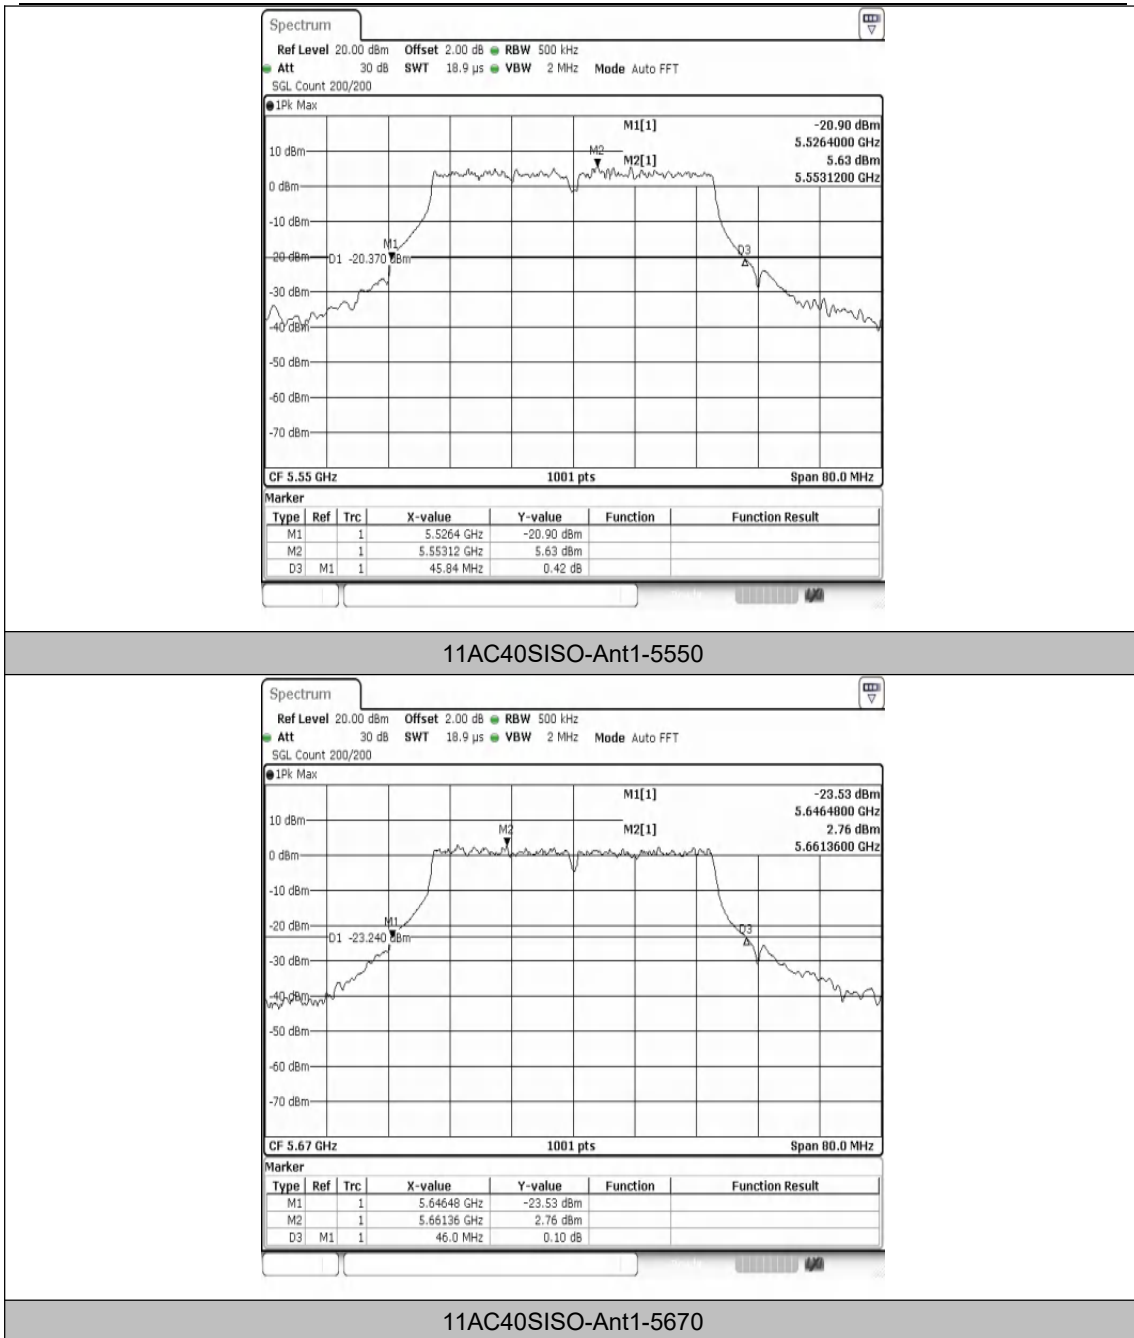


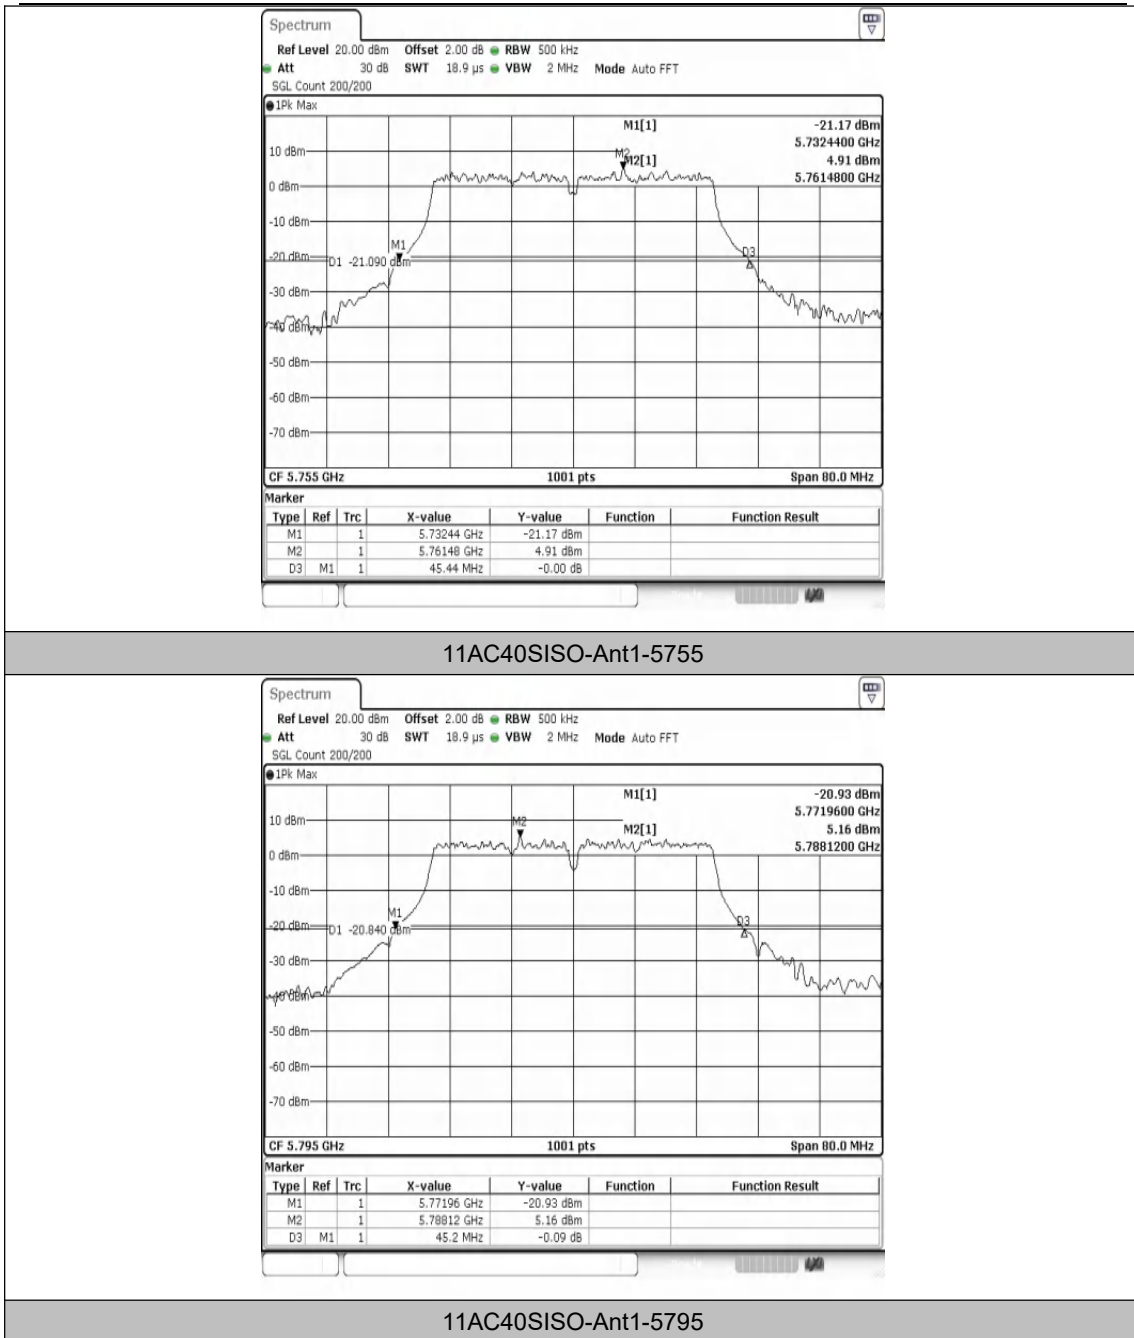


#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

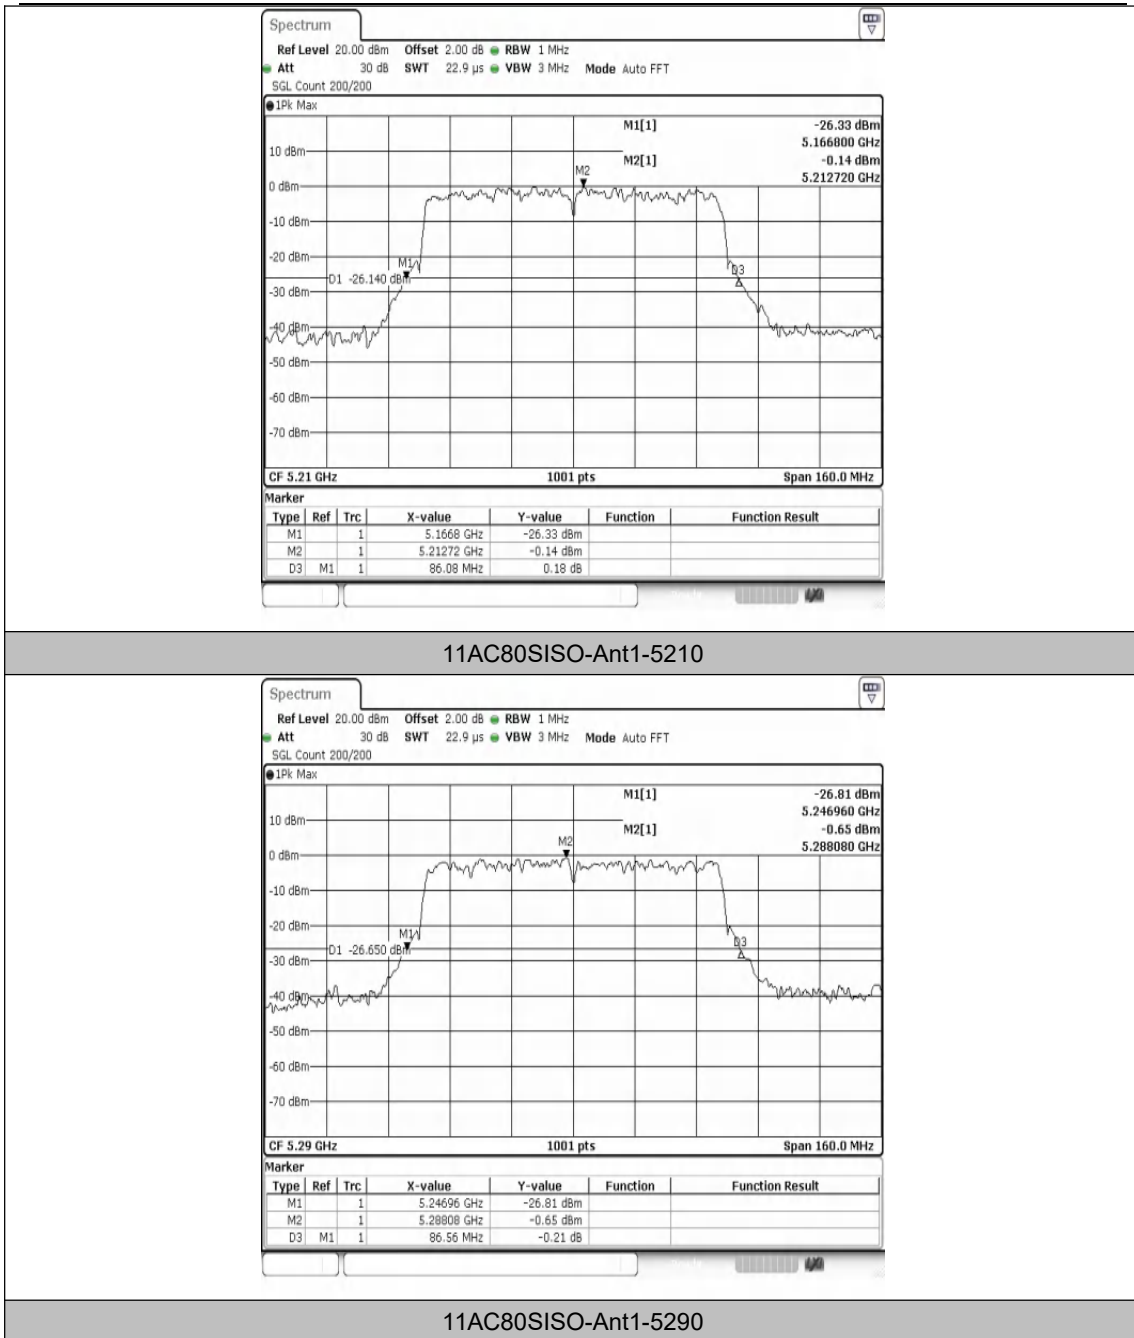

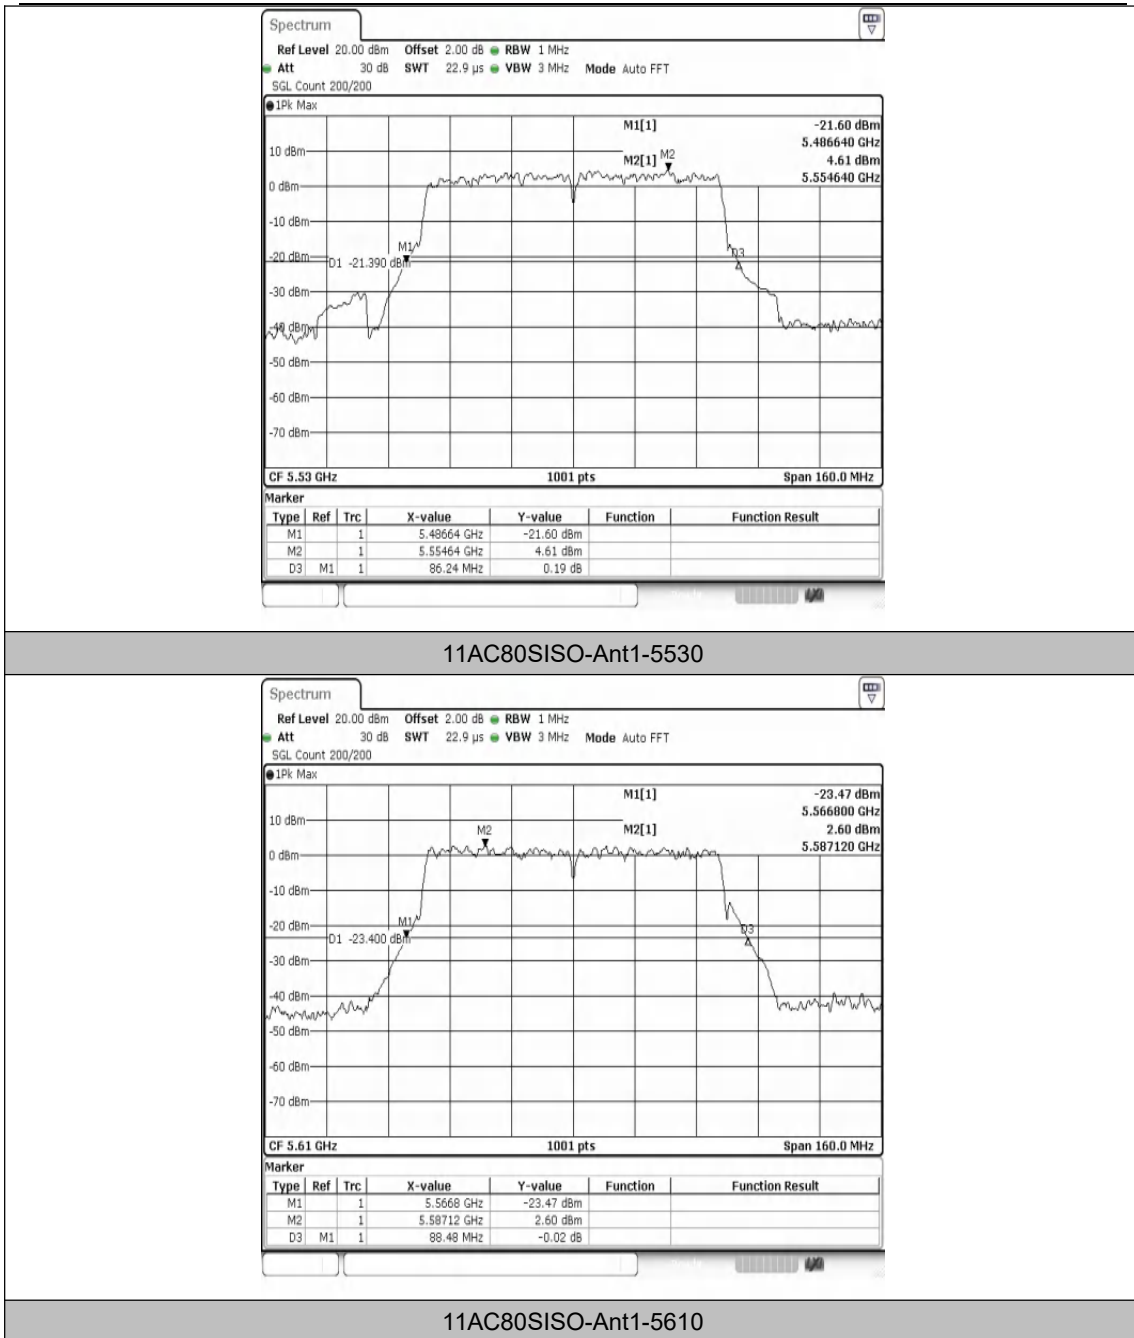




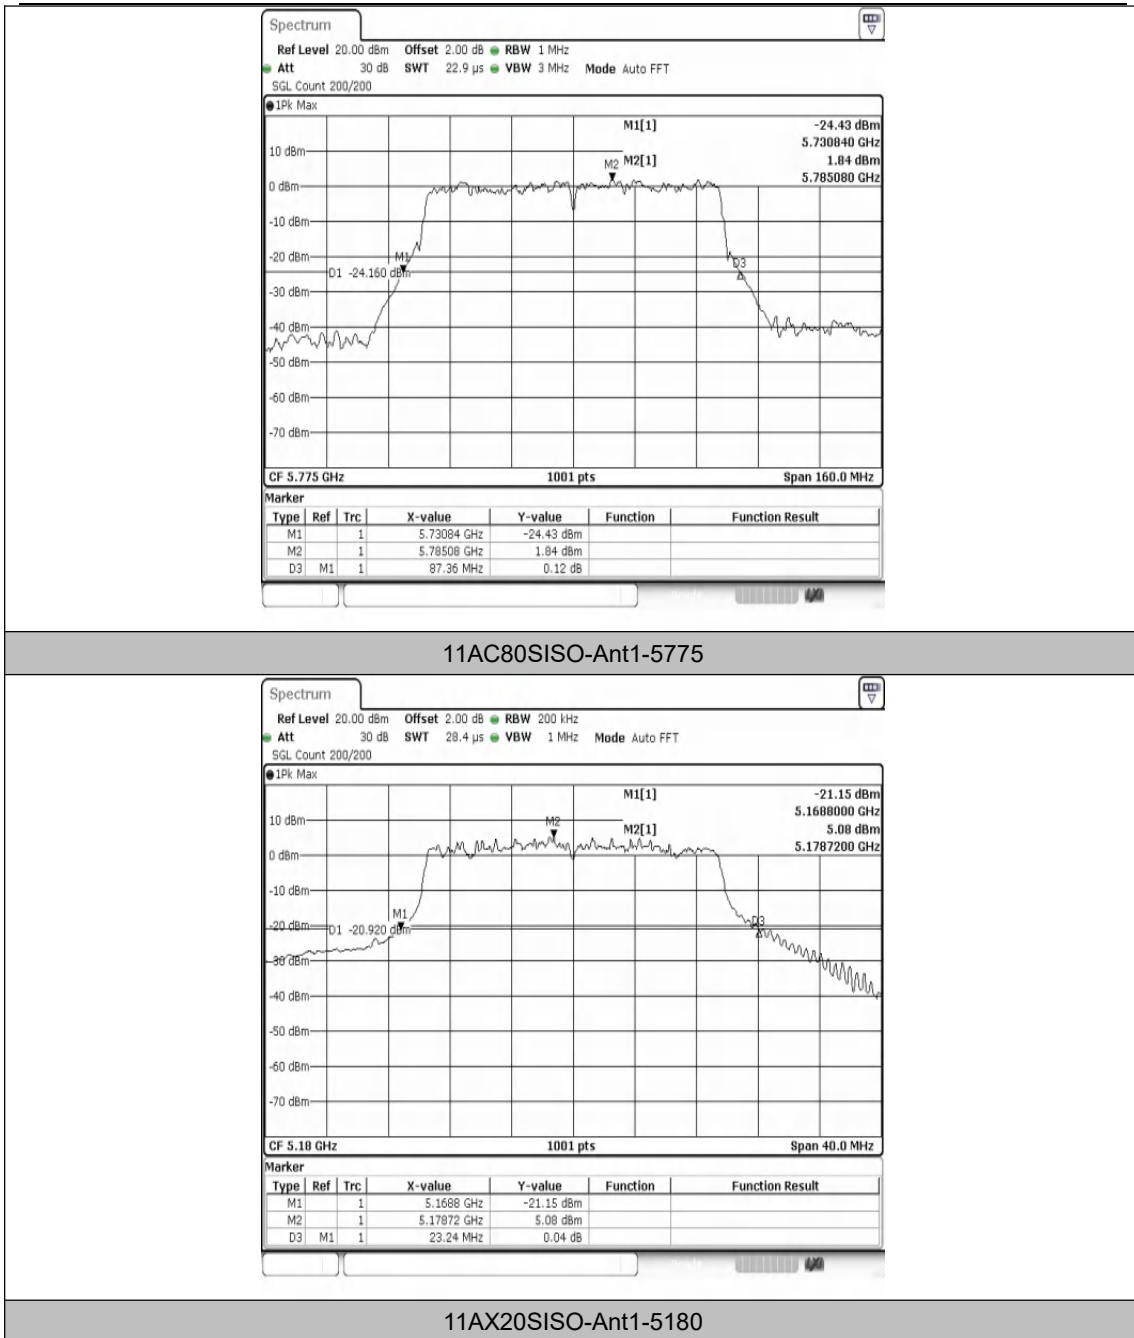


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

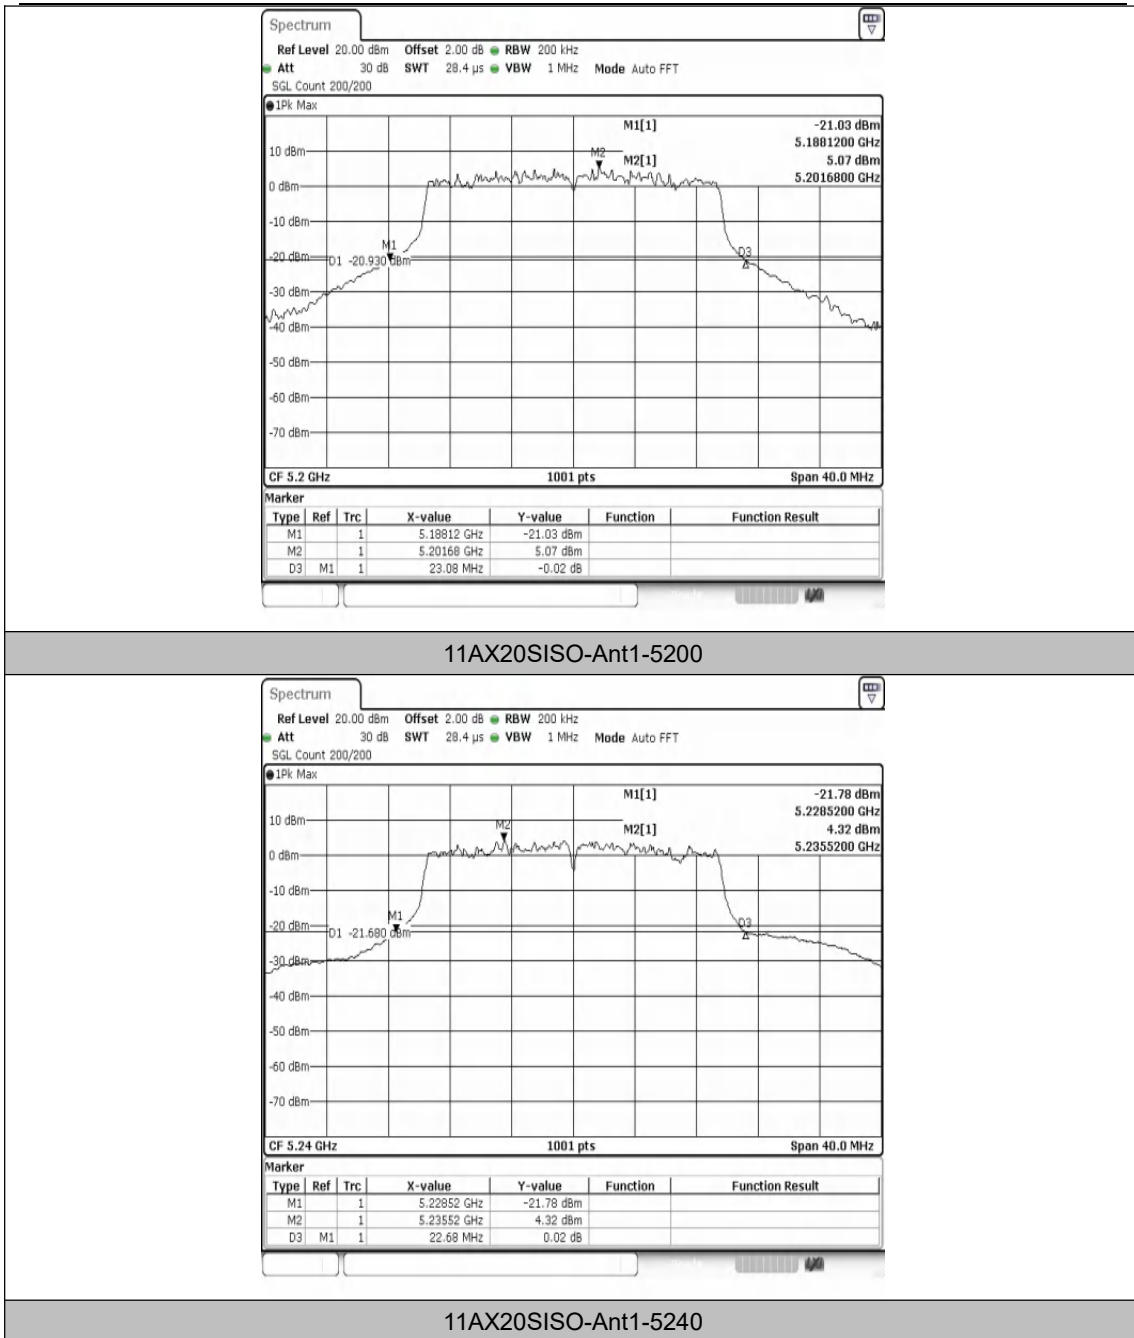


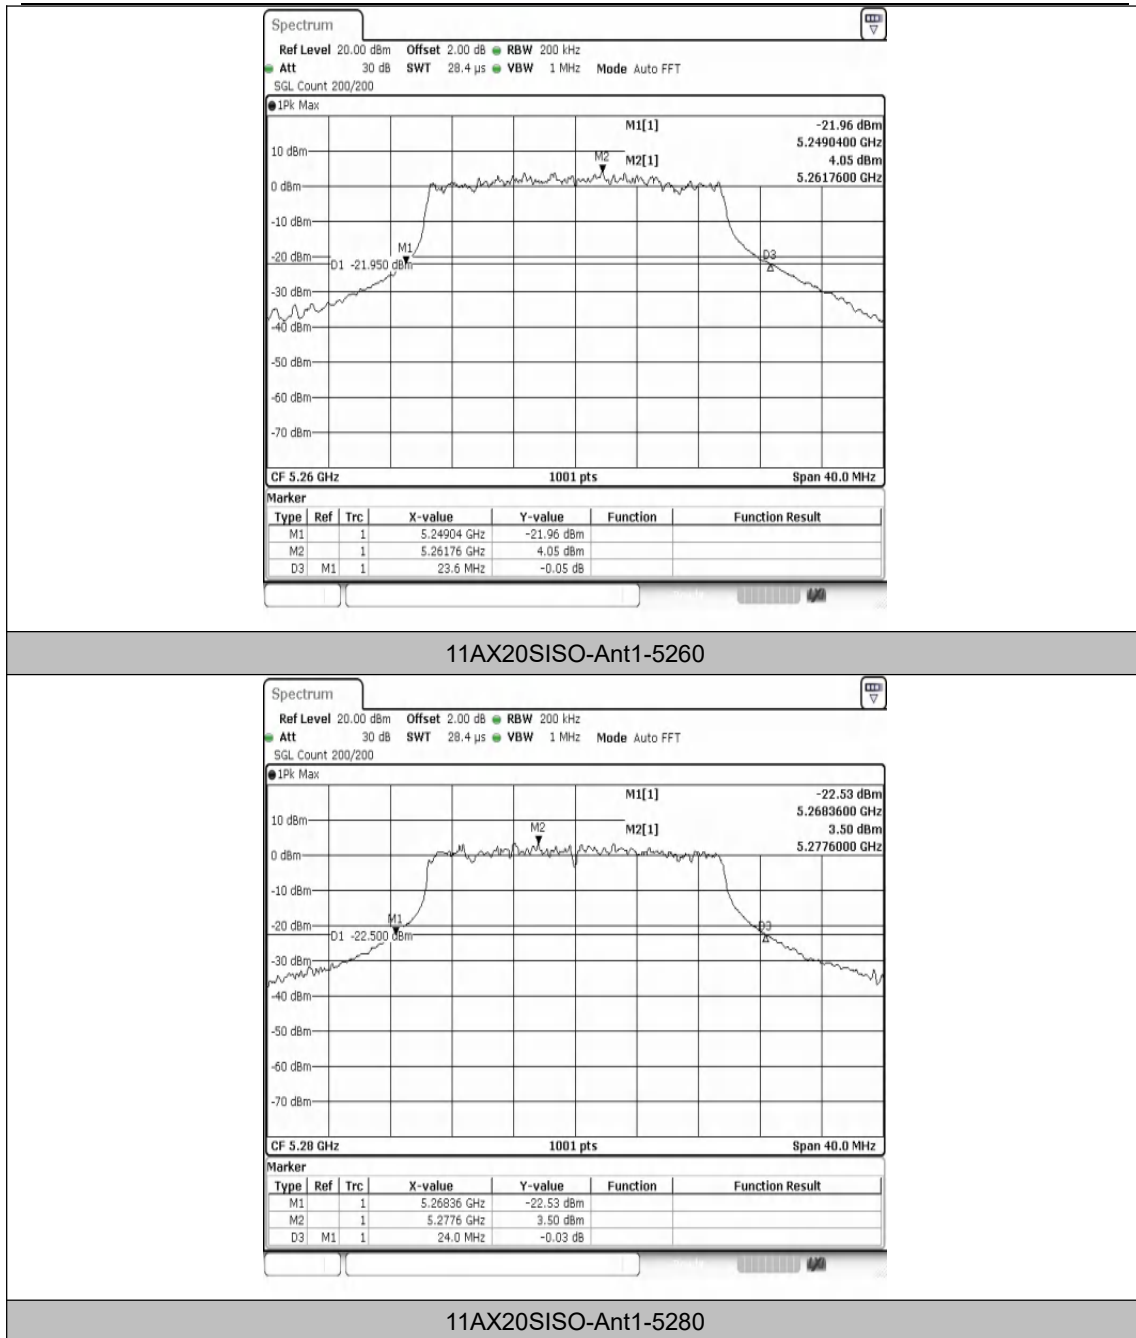



### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

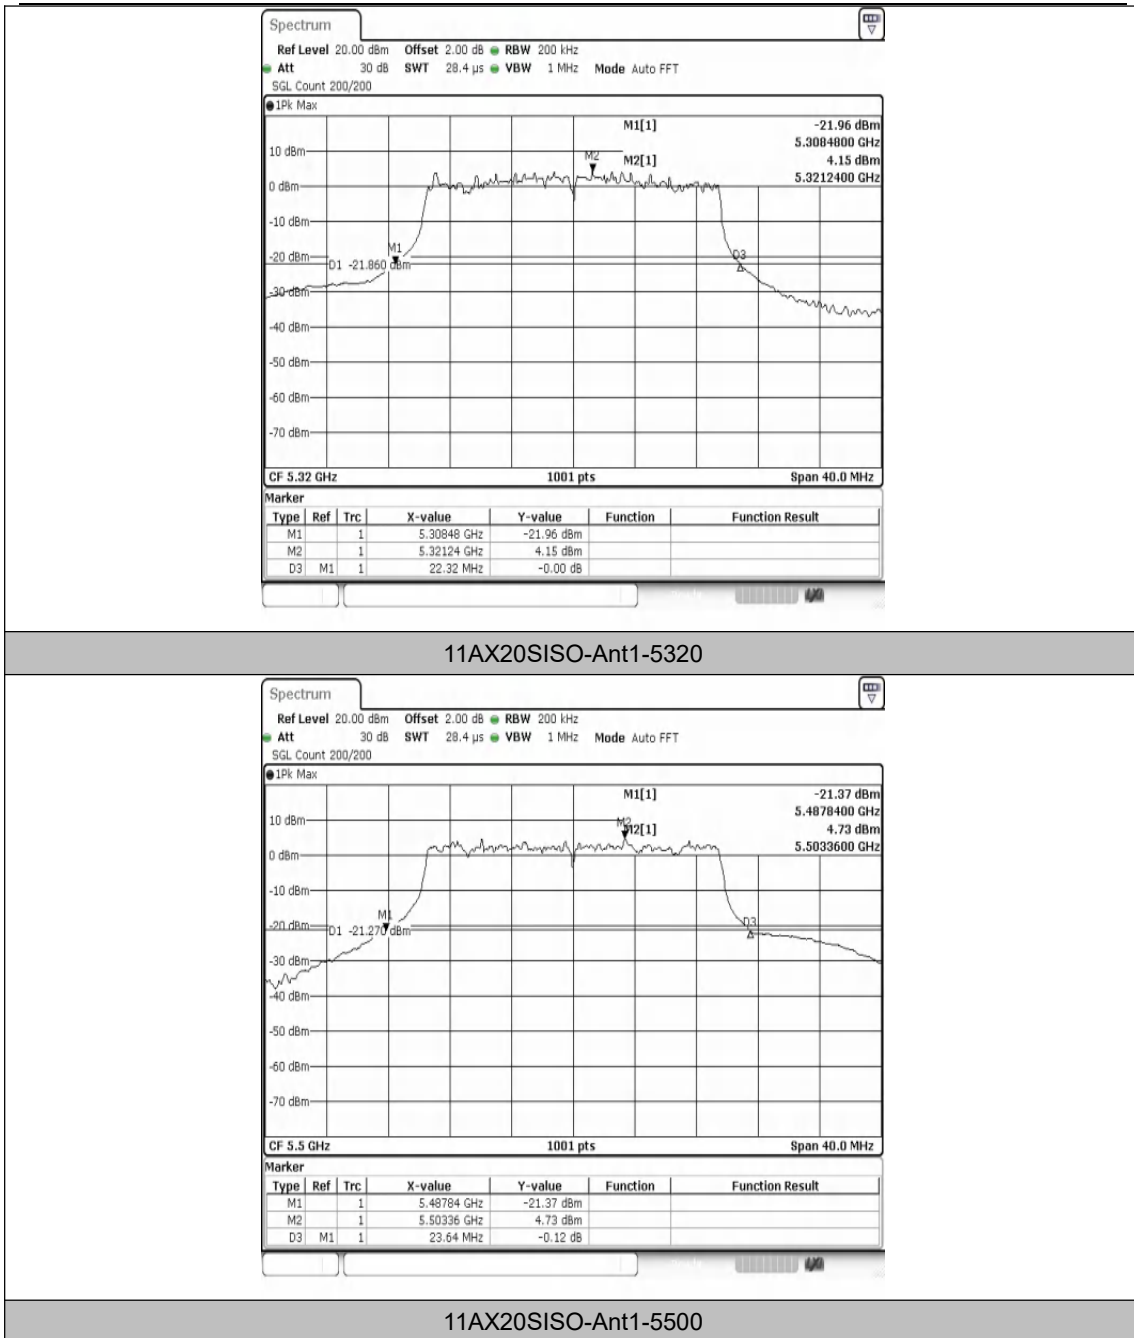


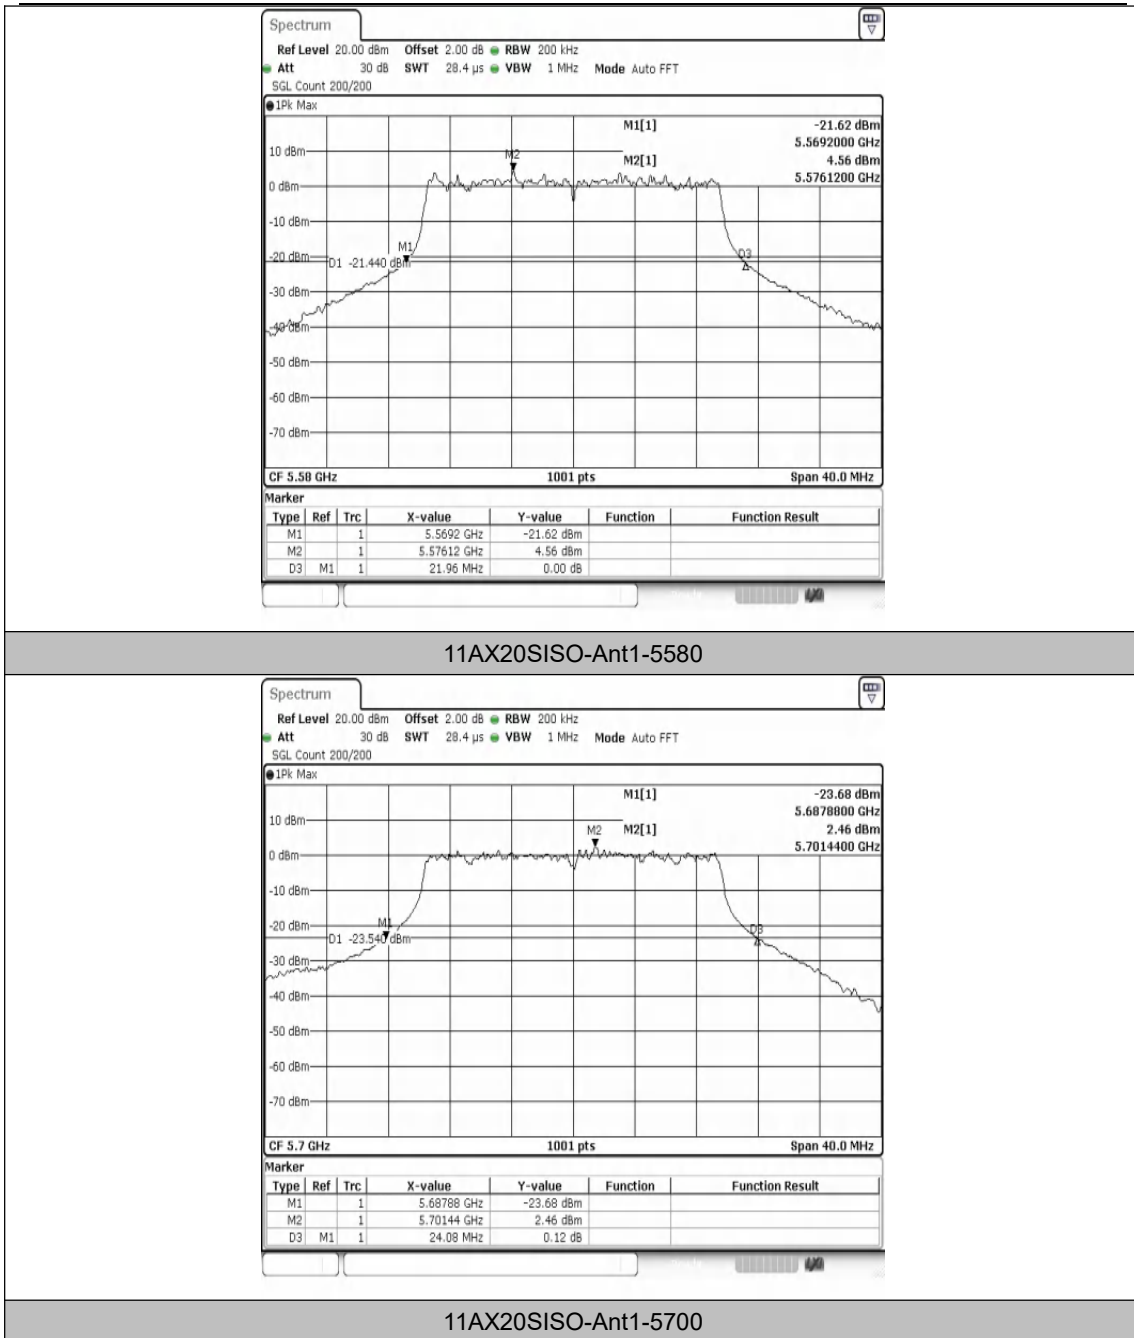


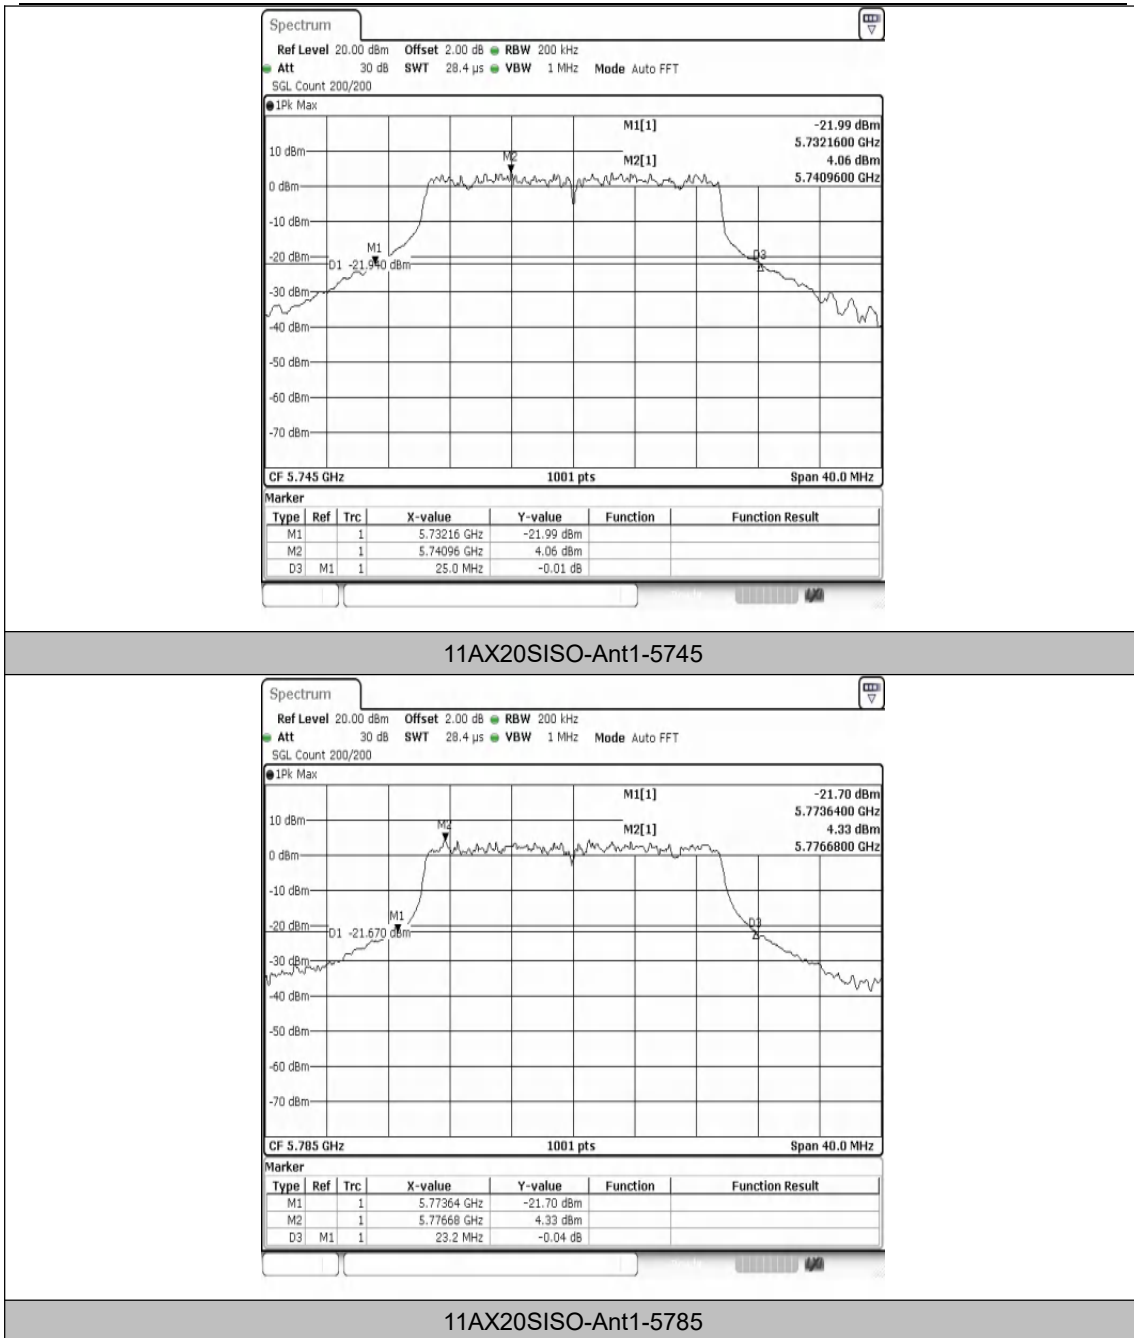




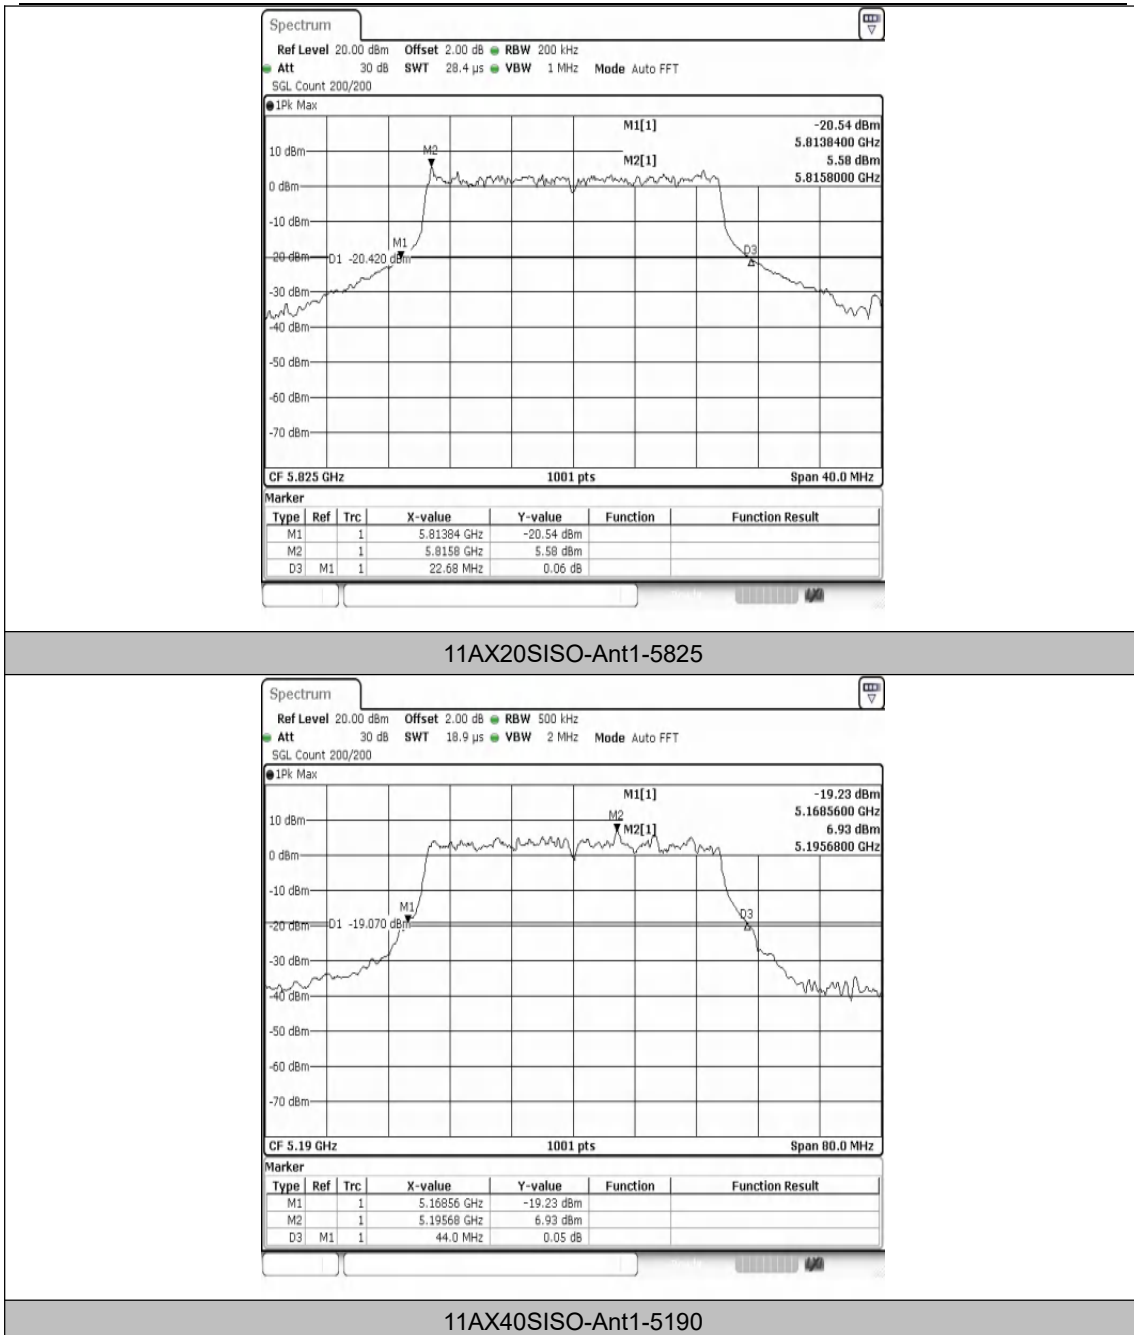

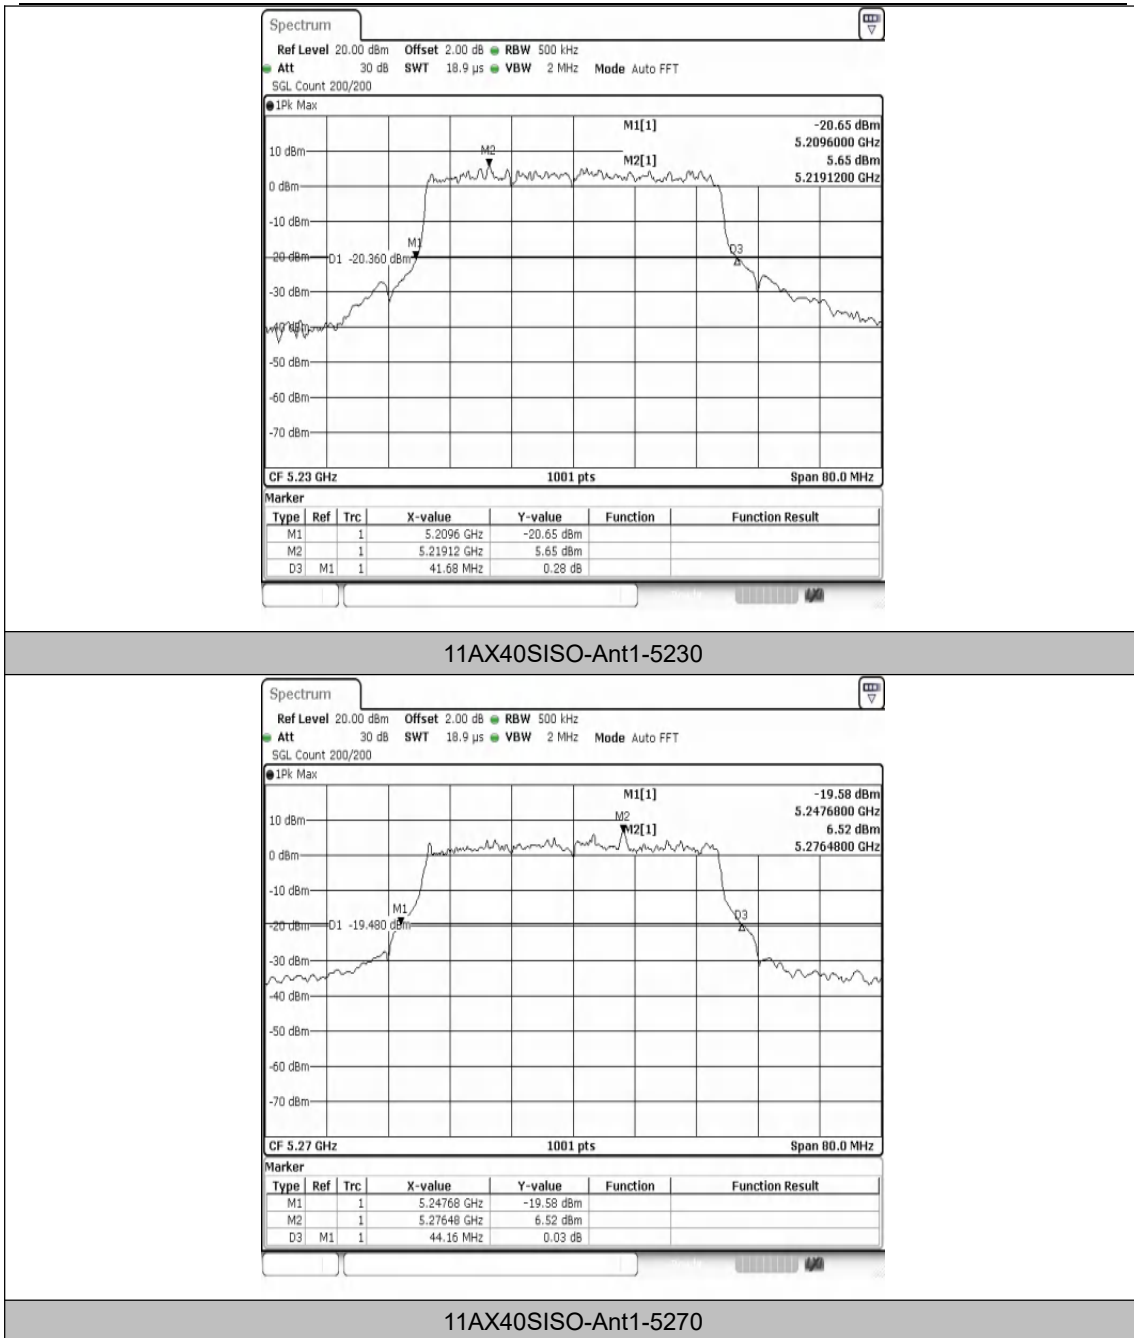

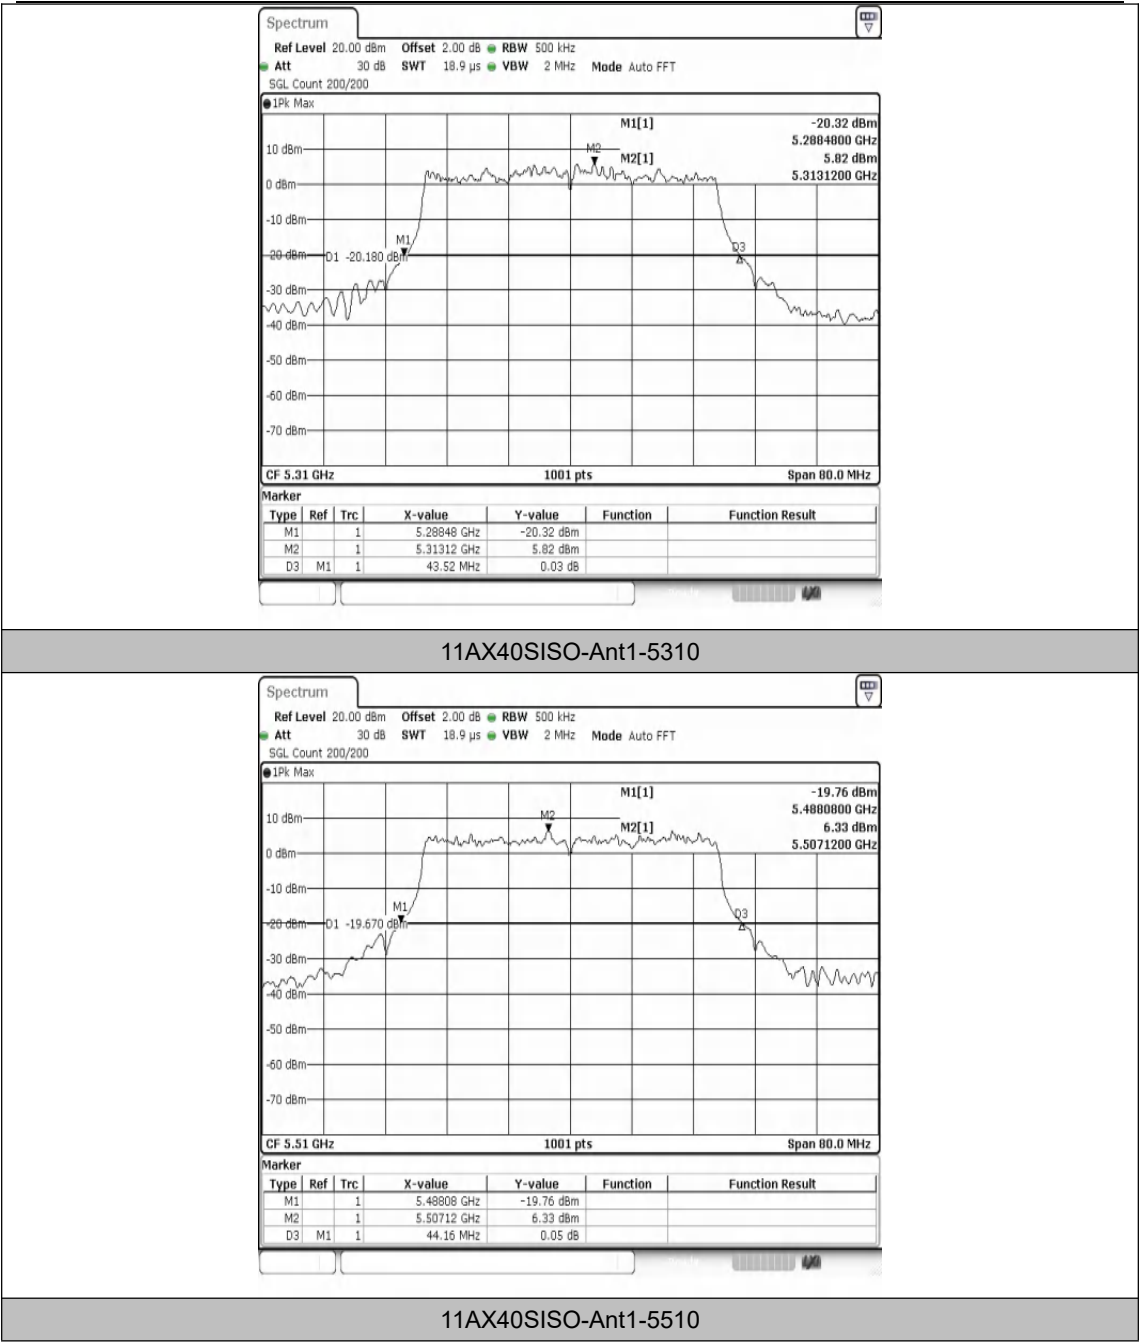


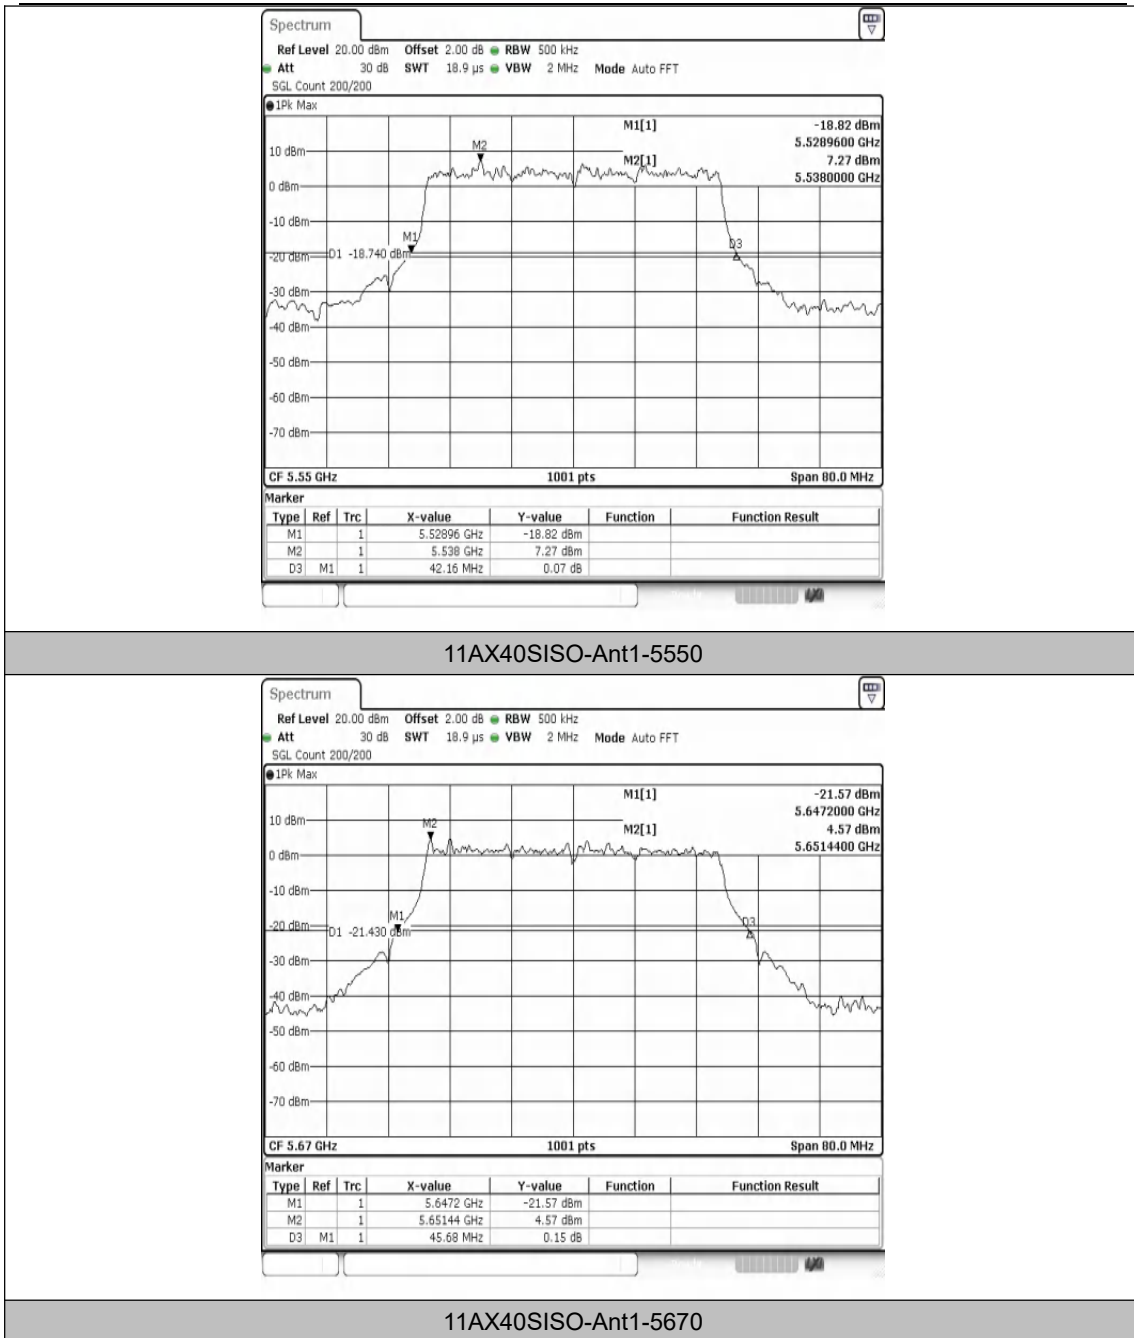


#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

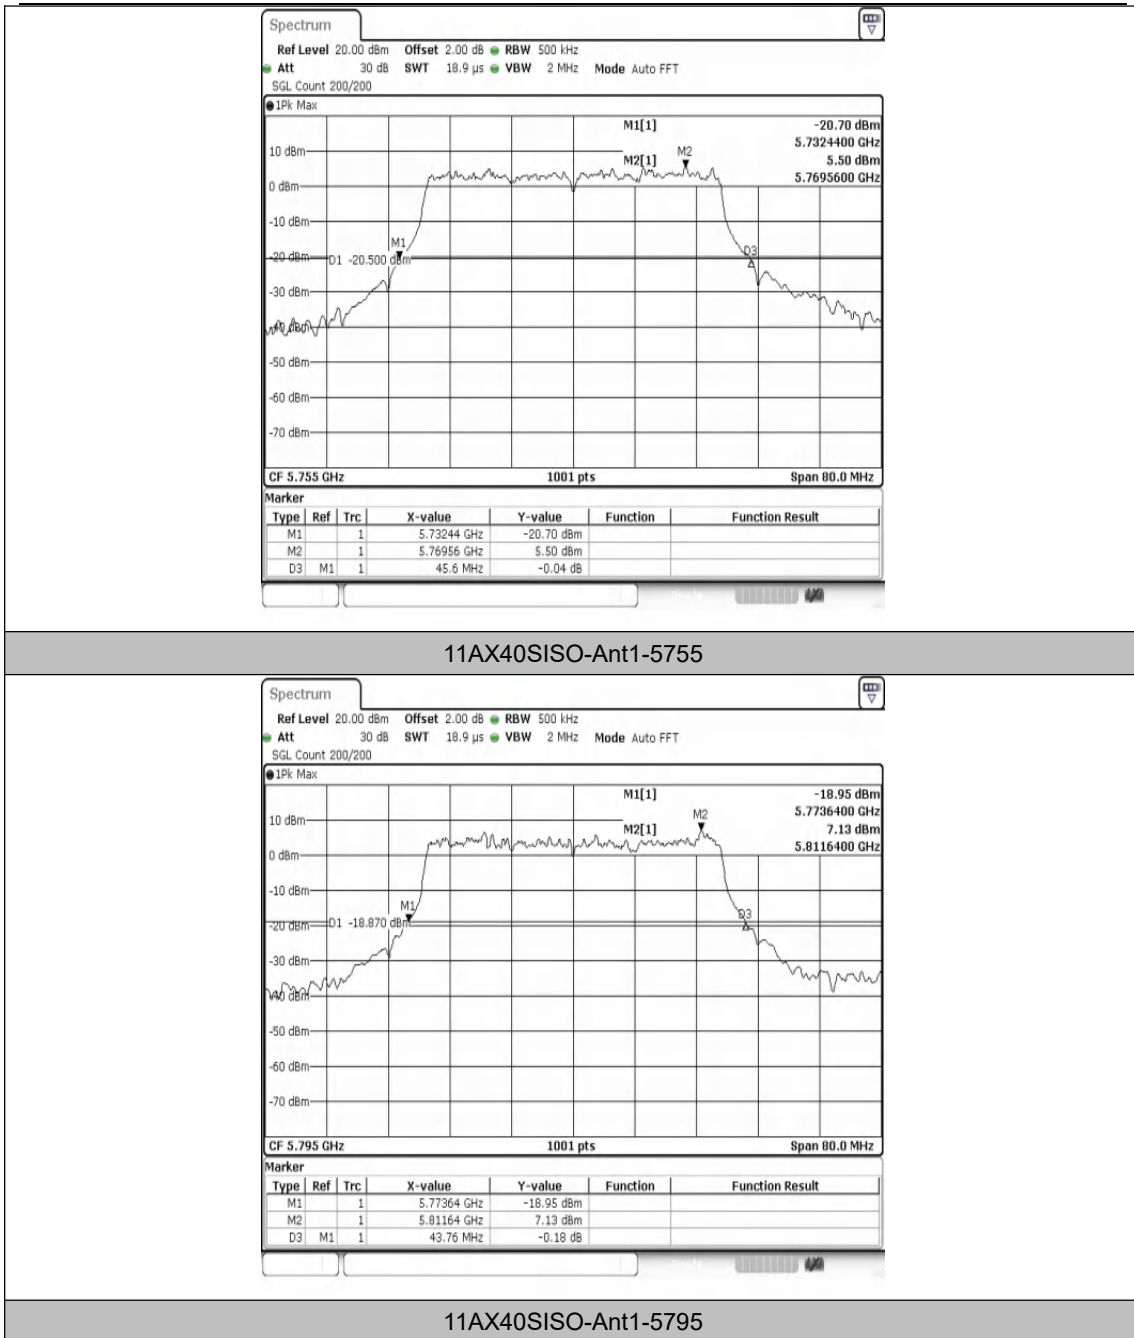

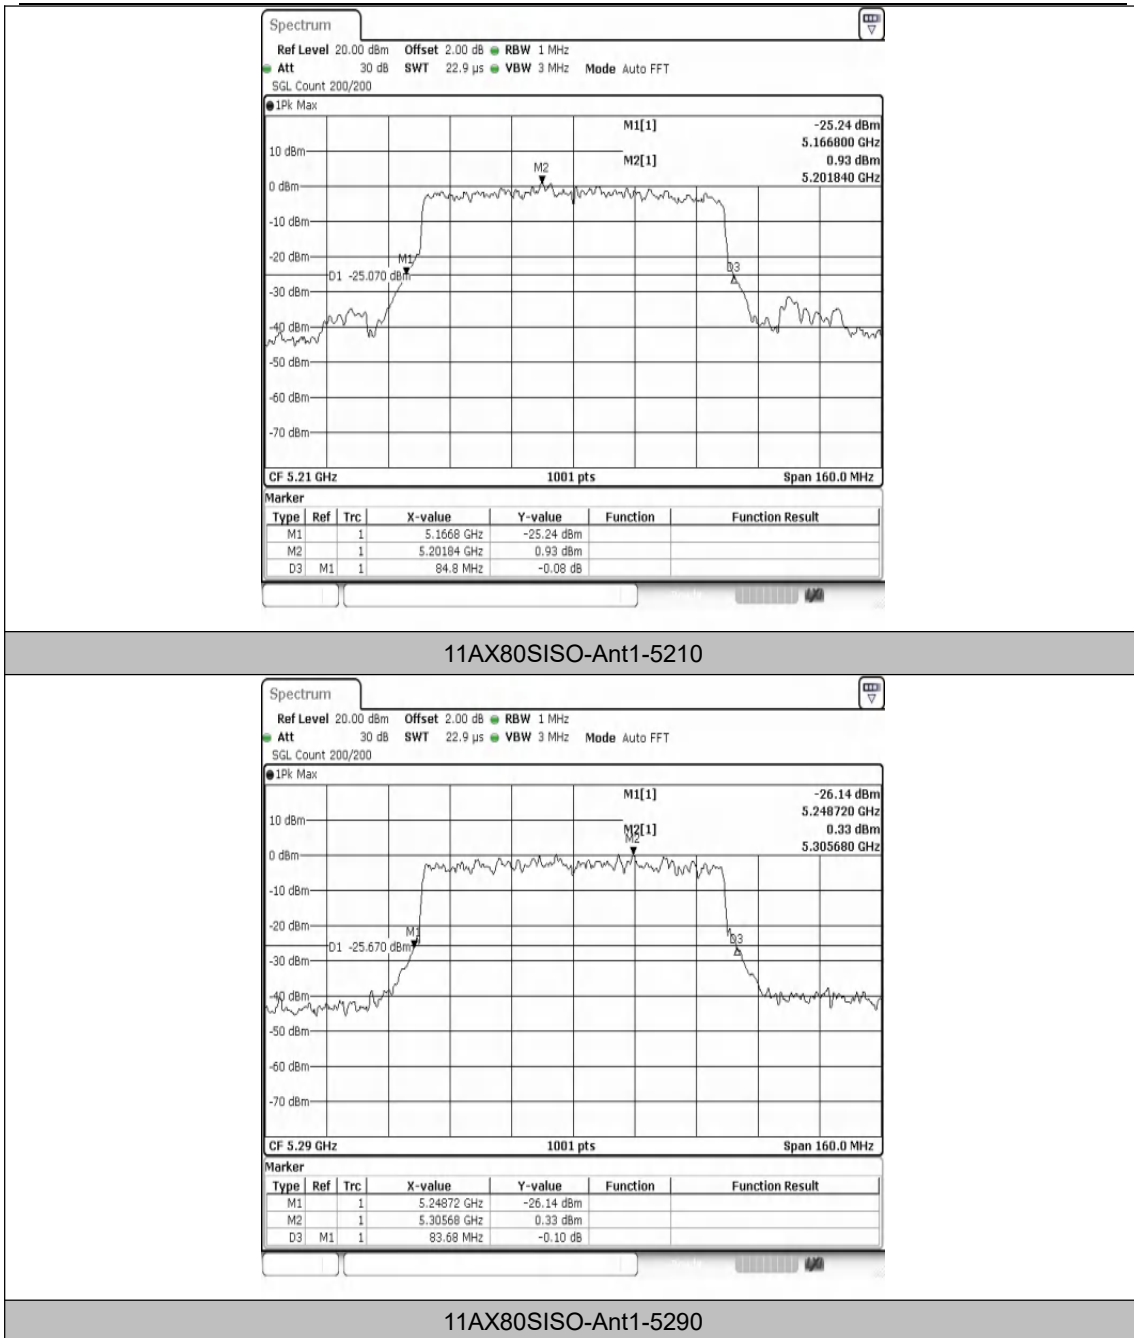



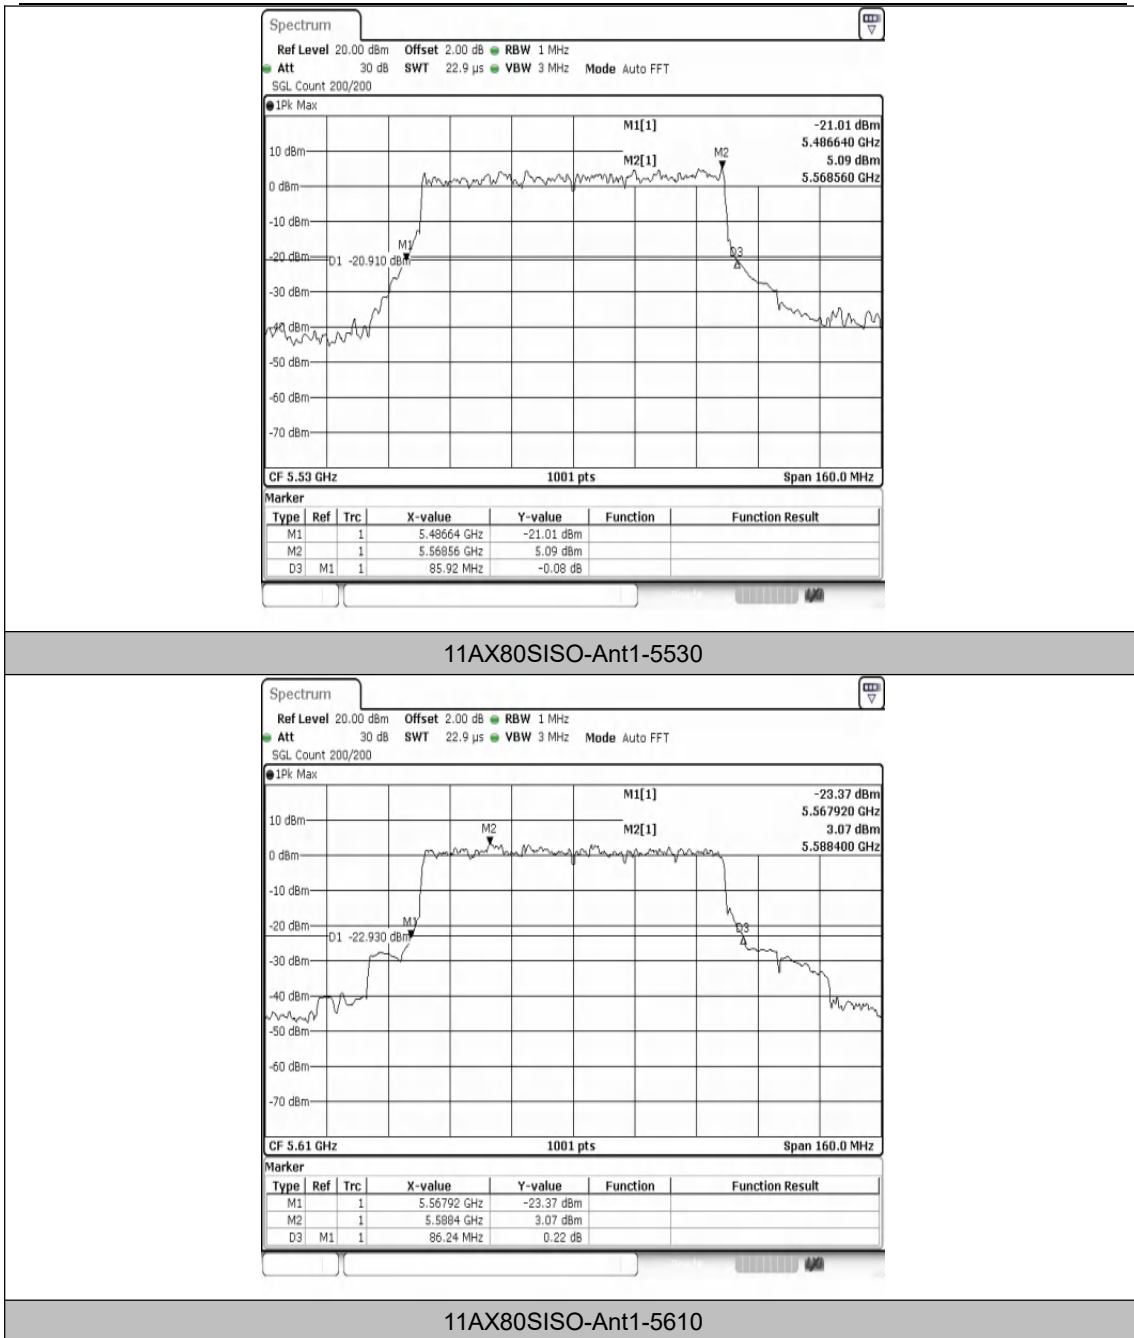



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix A2: 99% Occupied Bandwidth

### Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.264	5171.8881	5188.1518	---	---
11A	Ant1	5200	16.224	5191.9281	5208.1518	---	---
11A	Ant1	5240	16.224	5231.9281	5248.1518	---	---
11A	Ant1	5260	16.224	5251.8482	5268.0719	---	---
11A	Ant1	5280	16.224	5271.8881	5288.1119	---	---
11A	Ant1	5320	16.264	5311.8881	5328.1518	---	---
11A	Ant1	5500	16.184	5491.8881	5508.0719	---	---
11A	Ant1	5580	16.224	5571.8881	5588.1119	---	---
11A	Ant1	5700	16.224	5691.8881	5708.1119	---	---
11A	Ant1	5745	16.224	5736.8881	5753.1119	---	---
11A	Ant1	5785	16.224	5776.8881	5793.1119	---	---
11A	Ant1	5825	16.184	5816.8881	5833.0719	---	---
11N20SISO	Ant1	5180	17.303	5171.3686	5188.6713	---	---
11N20SISO	Ant1	5200	17.343	5191.3287	5208.6713	---	---
11N20SISO	Ant1	5240	17.343	5231.3287	5248.6713	---	---
11N20SISO	Ant1	5260	17.343	5251.3287	5268.6713	---	---
11N20SISO	Ant1	5280	17.343	5271.3287	5288.6713	---	---
11N20SISO	Ant1	5320	17.343	5311.3287	5328.6713	---	---
11N20SISO	Ant1	5500	17.303	5491.3287	5508.6314	---	---
11N20SISO	Ant1	5580	17.303	5571.3686	5588.6713	---	---
11N20SISO	Ant1	5700	17.343	5691.3287	5708.6713	---	---
11N20SISO	Ant1	5745	17.343	5736.3287	5753.6713	---	---
11N20SISO	Ant1	5785	17.303	5776.3287	5793.6314	---	---
11N20SISO	Ant1	5825	17.303	5816.3287	5833.6314	---	---
11N40SISO	Ant1	5190	35.724	5172.0979	5207.8222	---	---
11N40SISO	Ant1	5230	35.724	5212.0979	5247.8222	---	---
11N40SISO	Ant1	5270	35.724	5252.0979	5287.8222	---	---
11N40SISO	Ant1	5310	35.724	5292.0979	5327.8222	---	---
11N40SISO	Ant1	5510	35.724	5492.0180	5527.7423	---	---
11N40SISO	Ant1	5550	35.644	5532.0979	5567.7423	---	---
11N40SISO	Ant1	5670	35.644	5652.0979	5687.7423	---	---
11N40SISO	Ant1	5755	35.724	5737.0180	5772.7423	---	---
11N40SISO	Ant1	5795	35.724	5777.0180	5812.7423	---	---
11AC20SISO	Ant1	5180	17.383	5171.2887	5188.6713	---	---
11AC20SISO	Ant1	5200	17.383	5191.3287	5208.7113	---	---
11AC20SISO	Ant1	5240	17.383	5231.2887	5248.6713	---	---
11AC20SISO	Ant1	5260	17.383	5251.2887	5268.6713	---	---

11AC20SISO	Ant1	5280	17.343	5271.2887	5288.6314	---	---
11AC20SISO	Ant1	5320	17.383	5311.2887	5328.6713	---	---
11AC20SISO	Ant1	5500	17.423	5491.2488	5508.6713	---	---
11AC20SISO	Ant1	5580	17.463	5571.2488	5588.7113	---	---
11AC20SISO	Ant1	5700	17.383	5691.2887	5708.6713	---	---
11AC20SISO	Ant1	5745	17.343	5736.2887	5753.6314	---	---
11AC20SISO	Ant1	5785	17.423	5776.2488	5793.6713	---	---
11AC20SISO	Ant1	5825	17.423	5816.2488	5833.6713	---	---
11AC40SISO	Ant1	5190	35.564	5172.2577	5207.8222	---	---
11AC40SISO	Ant1	5230	35.485	5212.2577	5247.7423	---	---
11AC40SISO	Ant1	5270	35.485	5252.2577	5287.7423	---	---
11AC40SISO	Ant1	5310	35.485	5292.2577	5327.7423	---	---
11AC40SISO	Ant1	5510	35.485	5492.2577	5527.7423	---	---
11AC40SISO	Ant1	5550	35.485	5532.2577	5567.7423	---	---
11AC40SISO	Ant1	5670	35.485	5652.2577	5687.7423	---	---
11AC40SISO	Ant1	5755	35.485	5737.2577	5772.7423	---	---
11AC40SISO	Ant1	5795	35.564	5777.1778	5812.7423	---	---
11AC80SISO	Ant1	5210	75.924	5171.6384	5247.5624	---	---
11AC80SISO	Ant1	5290	76.244	5251.6384	5327.8821	---	---
11AC80SISO	Ant1	5530	75.604	5492.2777	5567.8821	---	---
11AC80SISO	Ant1	5610	75.924	5571.7982	5647.7223	---	---
11AC80SISO	Ant1	5775	75.924	5736.7982	5812.7223	---	---
11AX20SISO	Ant1	5180	18.661	5170.6094	5189.2707	---	---
11AX20SISO	Ant1	5200	18.621	5190.6494	5209.2707	---	---
11AX20SISO	Ant1	5240	18.581	5230.6094	5249.1908	---	---
11AX20SISO	Ant1	5260	18.621	5250.6094	5269.2308	---	---
11AX20SISO	Ant1	5280	18.621	5270.6094	5289.2308	---	---
11AX20SISO	Ant1	5320	18.581	5310.6094	5329.1908	---	---
11AX20SISO	Ant1	5500	18.621	5490.6094	5509.2308	---	---
11AX20SISO	Ant1	5580	18.621	5570.6094	5589.2308	---	---
11AX20SISO	Ant1	5700	18.581	5690.6494	5709.2308	---	---
11AX20SISO	Ant1	5745	18.661	5735.6094	5754.2707	---	---
11AX20SISO	Ant1	5785	18.621	5775.6094	5794.2308	---	---
11AX20SISO	Ant1	5825	18.581	5815.6094	5834.1908	---	---
11AX40SISO	Ant1	5190	37.003	5171.5385	5208.5415	---	---
11AX40SISO	Ant1	5230	37.083	5211.5385	5248.6214	---	---
11AX40SISO	Ant1	5270	37.083	5251.5385	5288.6214	---	---
11AX40SISO	Ant1	5310	37.083	5291.5385	5328.6214	---	---
11AX40SISO	Ant1	5510	37.003	5491.5385	5528.5415	---	---
11AX40SISO	Ant1	5550	37.003	5531.5385	5568.5415	---	---
11AX40SISO	Ant1	5670	36.843	5651.6983	5688.5415	---	---
11AX40SISO	Ant1	5755	37.003	5736.5385	5773.5415	---	---

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


11AX40SISO	Ant1	5795	36.843	5776.5385	5813.3816	---	---
11AX80SISO	Ant1	5210	76.723	5171.6384	5248.3616	---	---
11AX80SISO	Ant1	5290	76.883	5251.6384	5328.5215	---	---
11AX80SISO	Ant1	5530	76.563	5491.9580	5568.5215	---	---
11AX80SISO	Ant1	5610	76.723	5571.7982	5648.5215	---	---
11AX80SISO	Ant1	5775	76.723	5736.7982	5813.5215	---	---

**Shenzhen Anbotek Compliance Laboratory Limited**


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Test Graphs

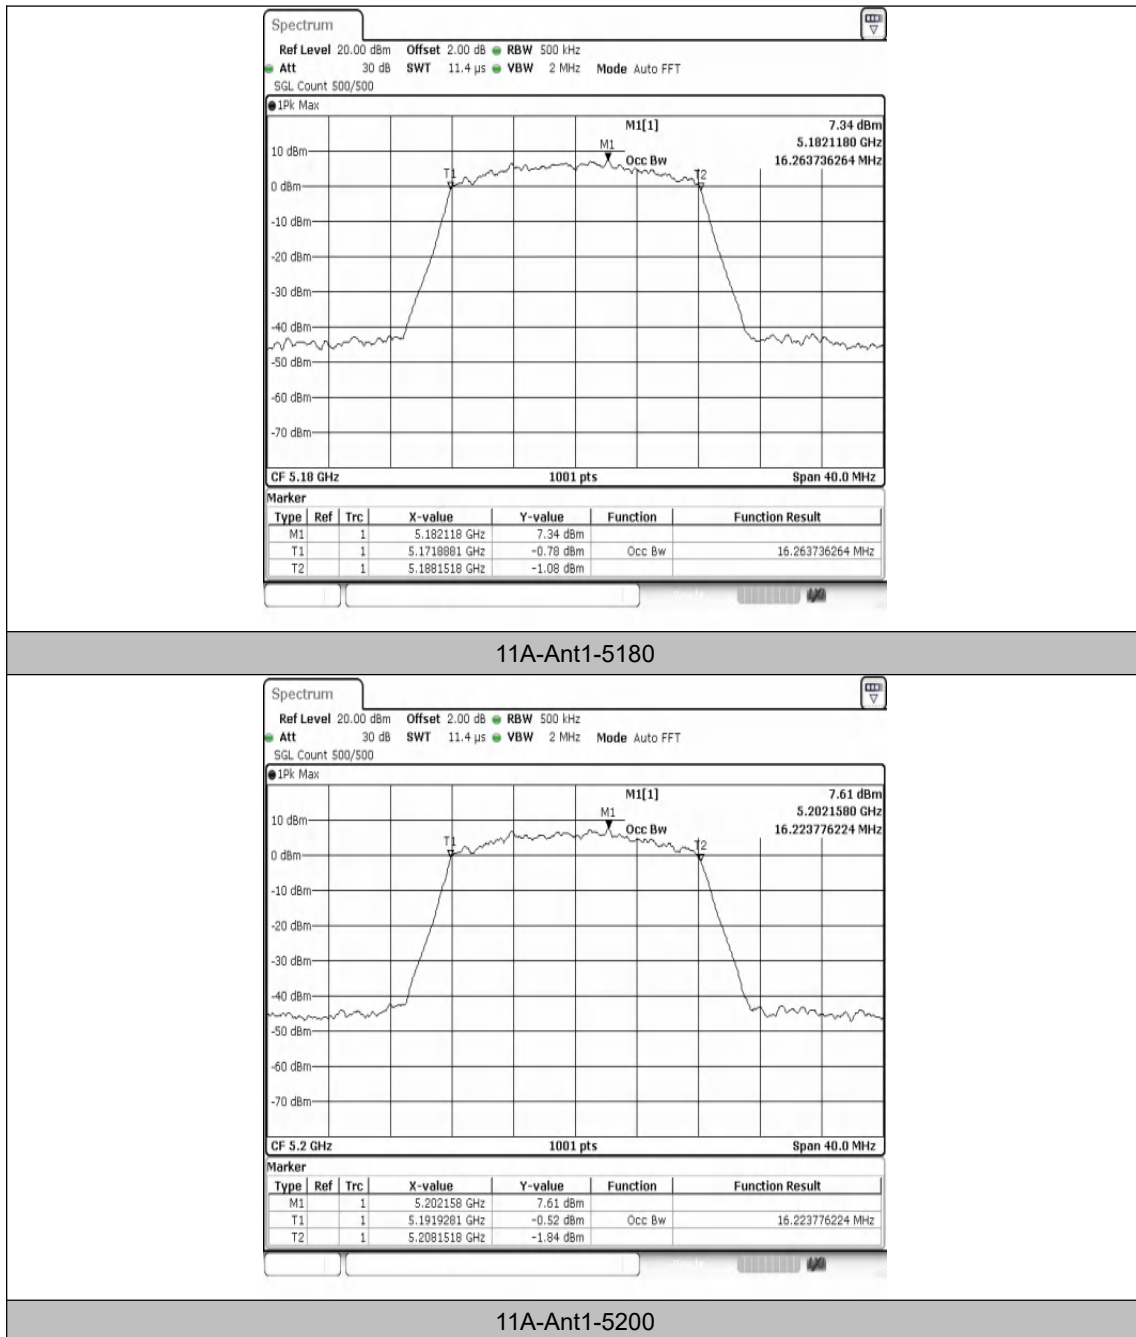





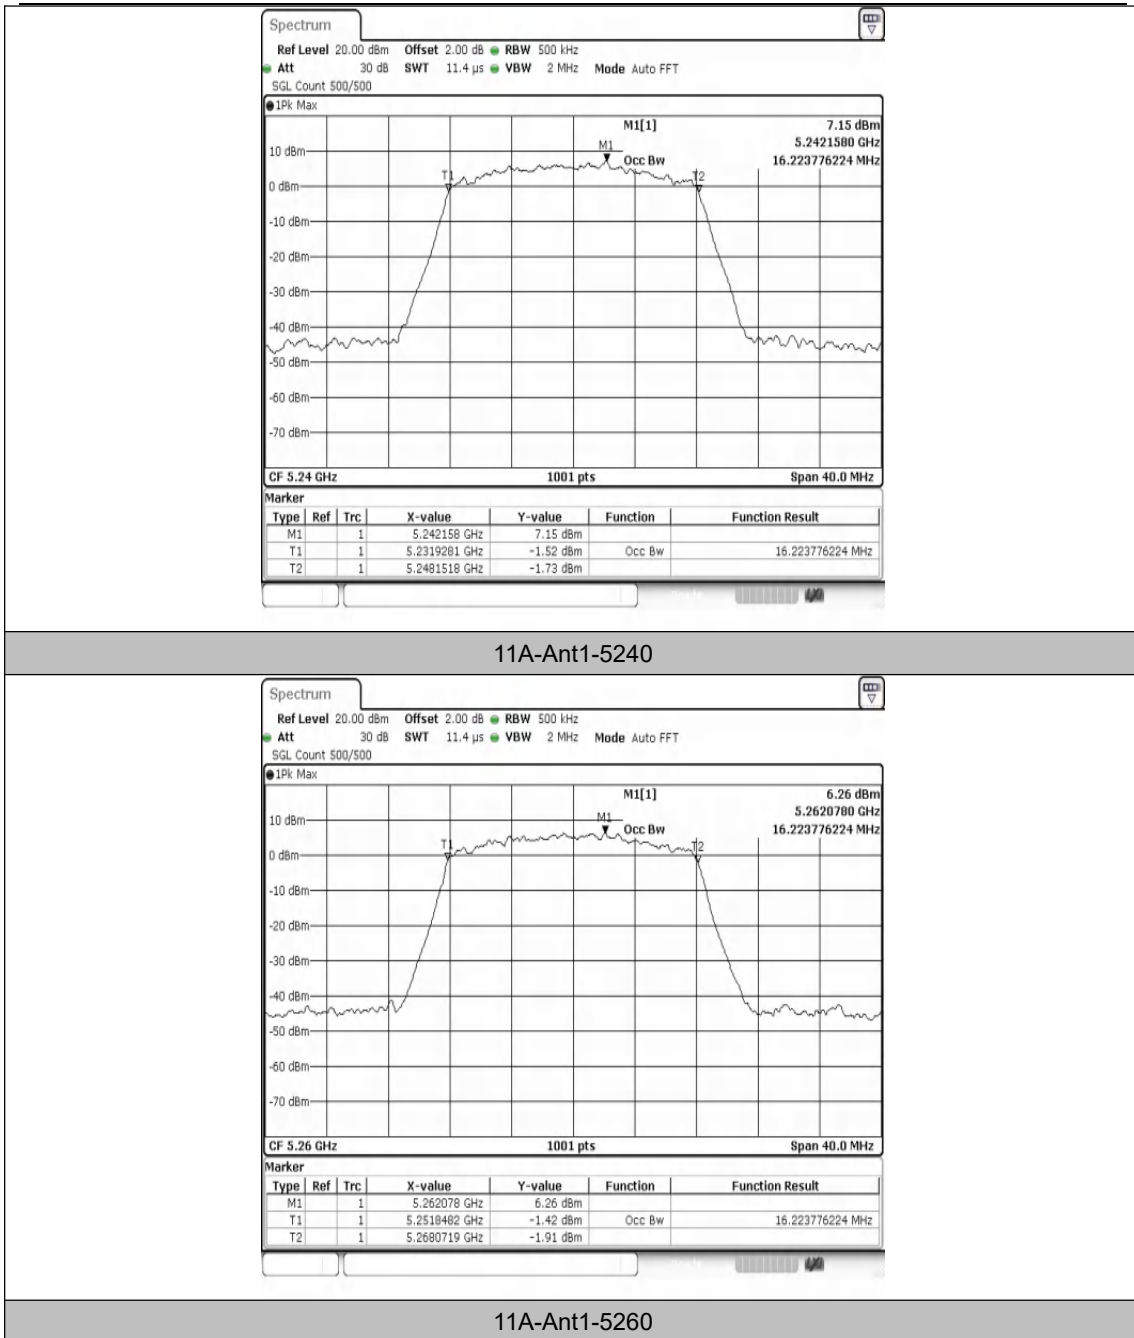

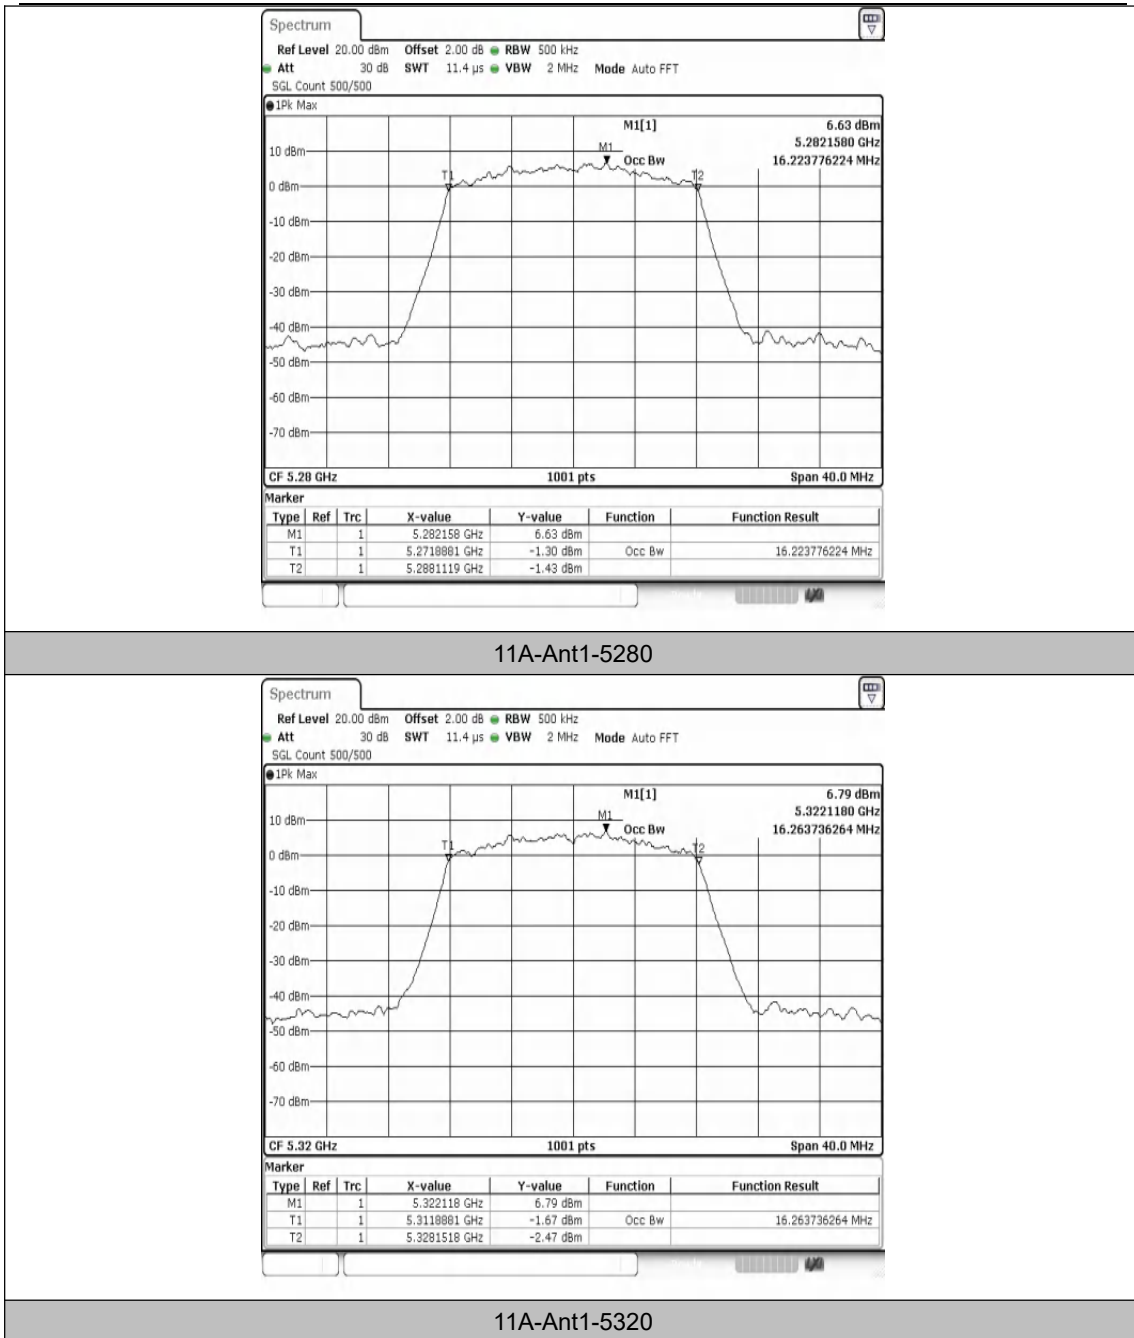


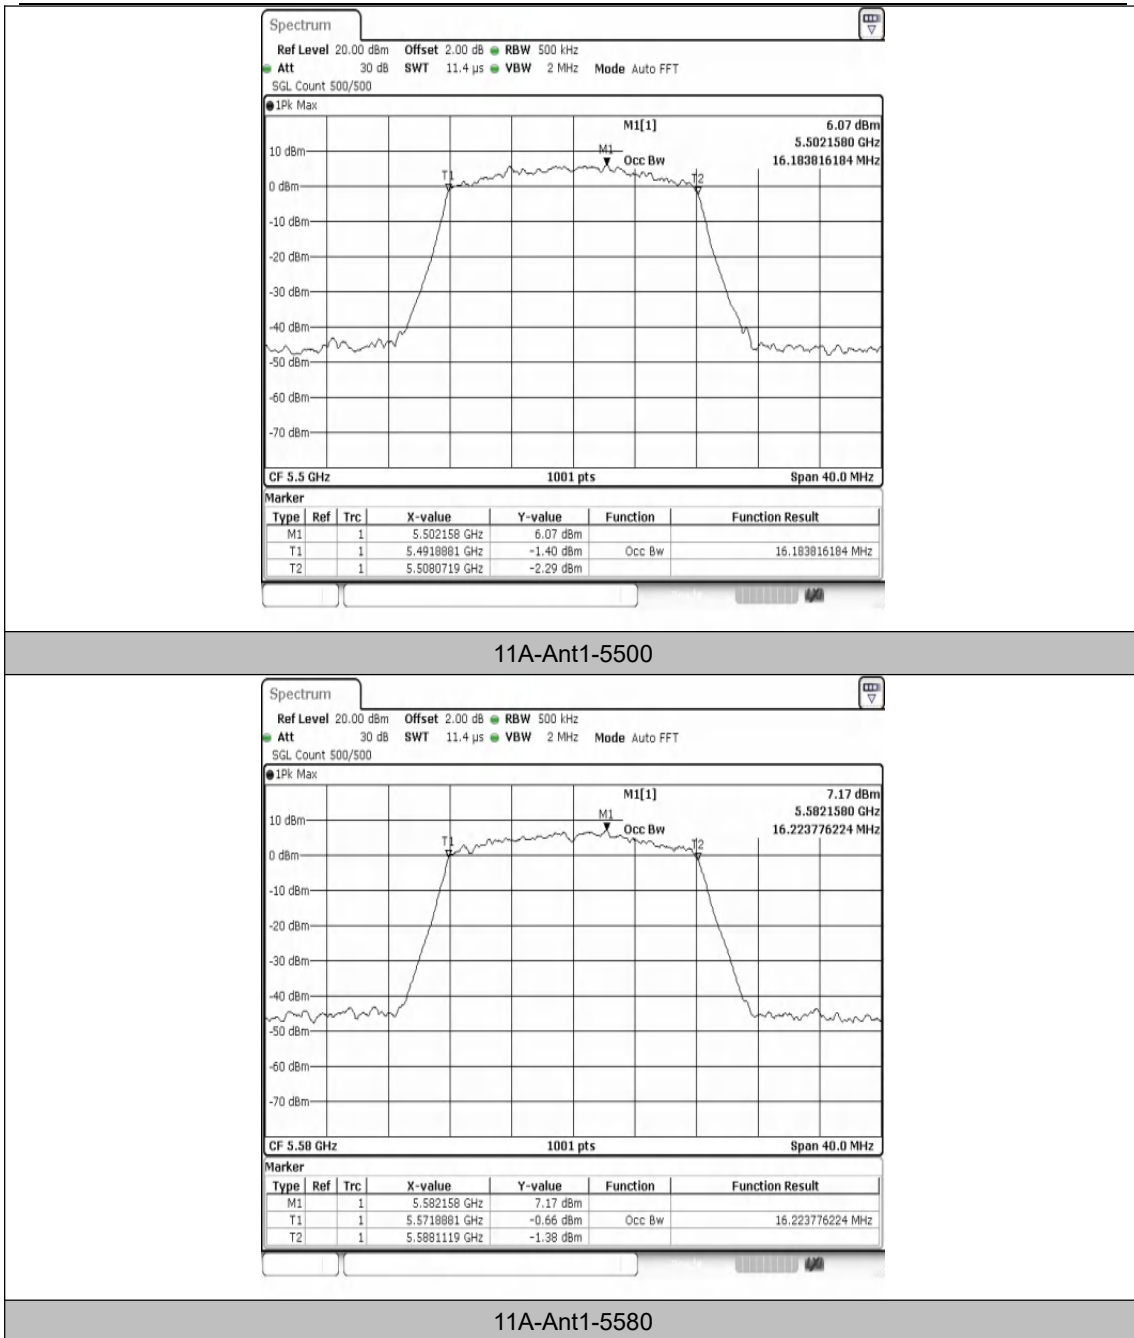

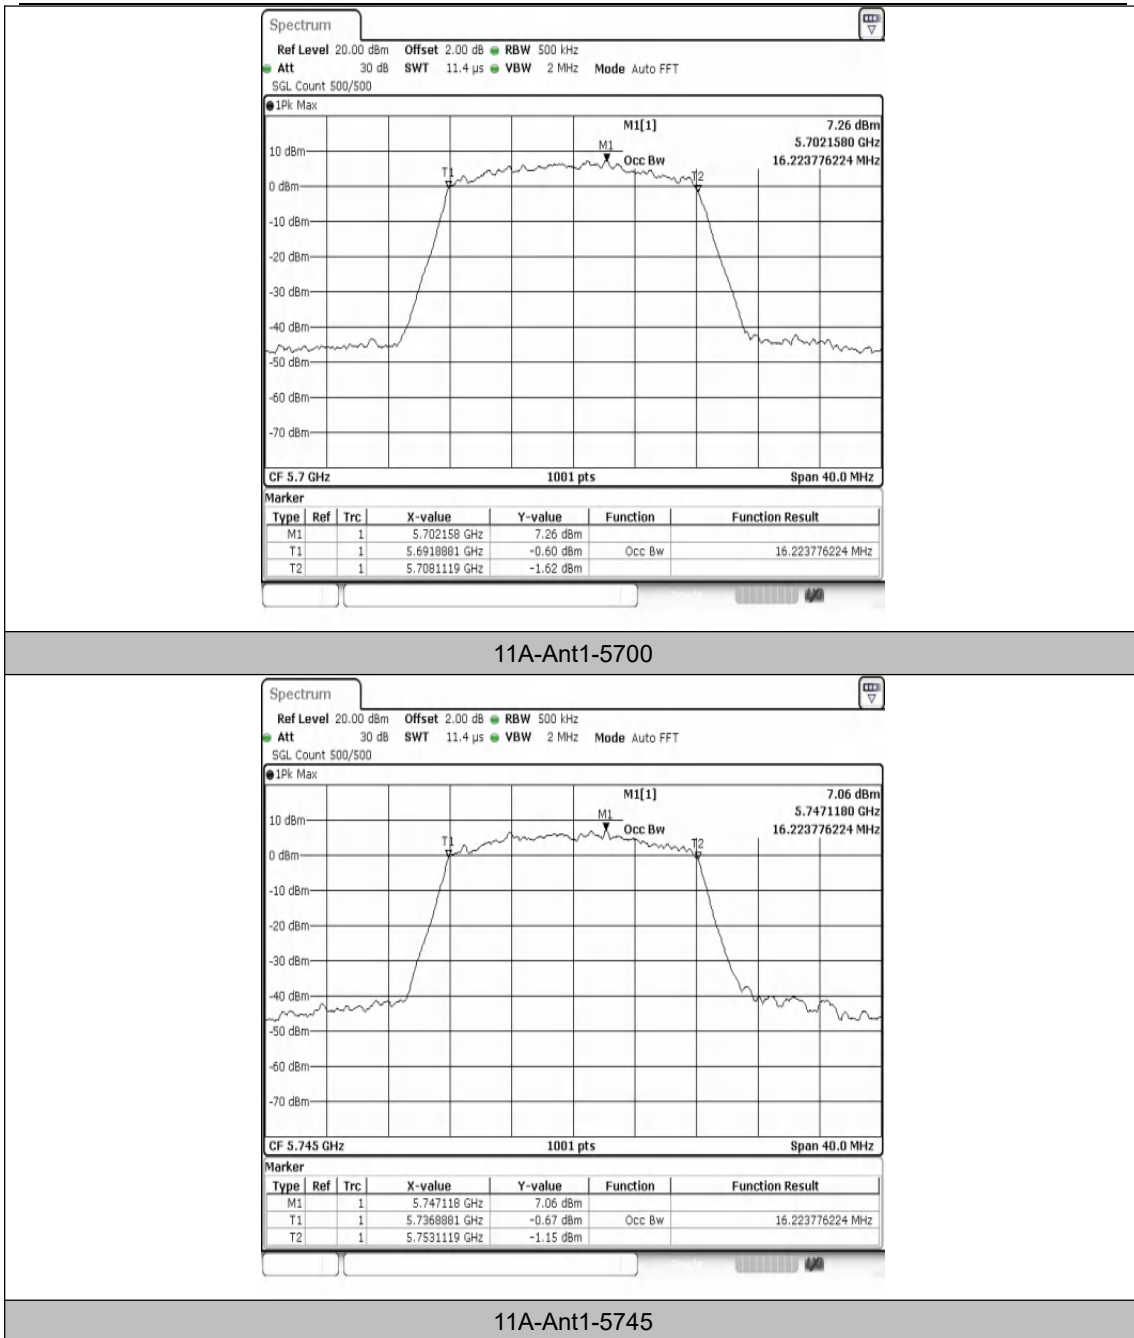


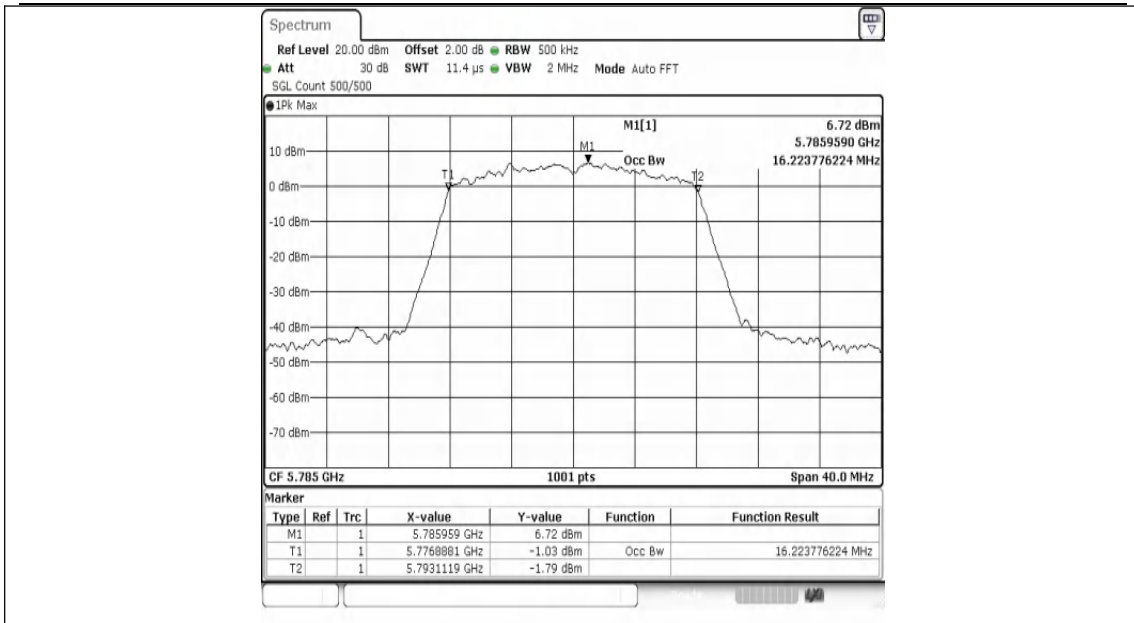


11A-Ant1-5785

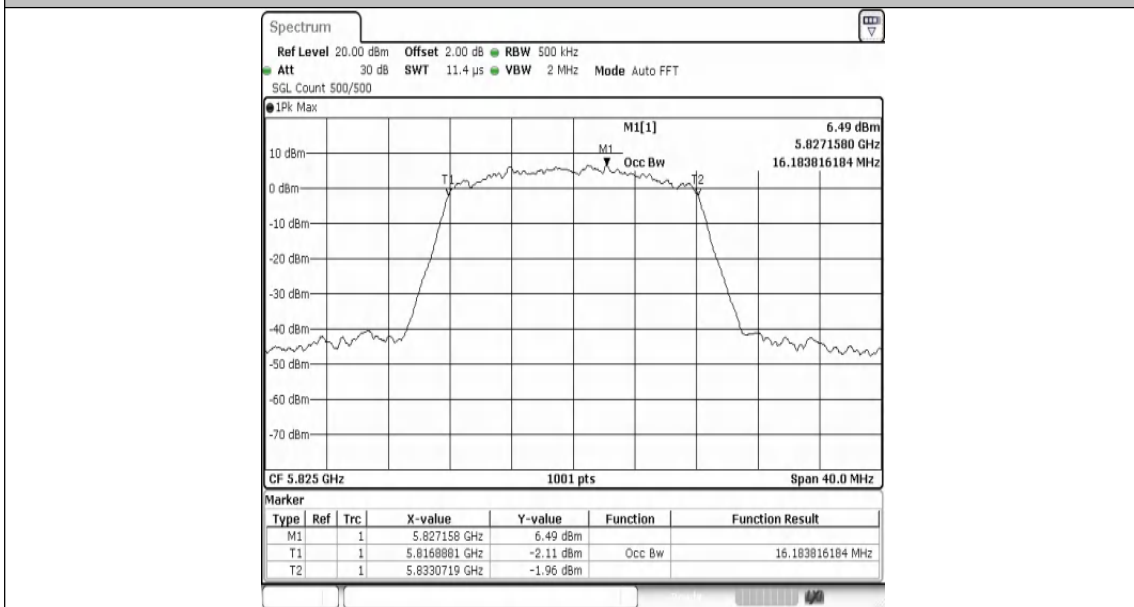



11A-Ant1-5825

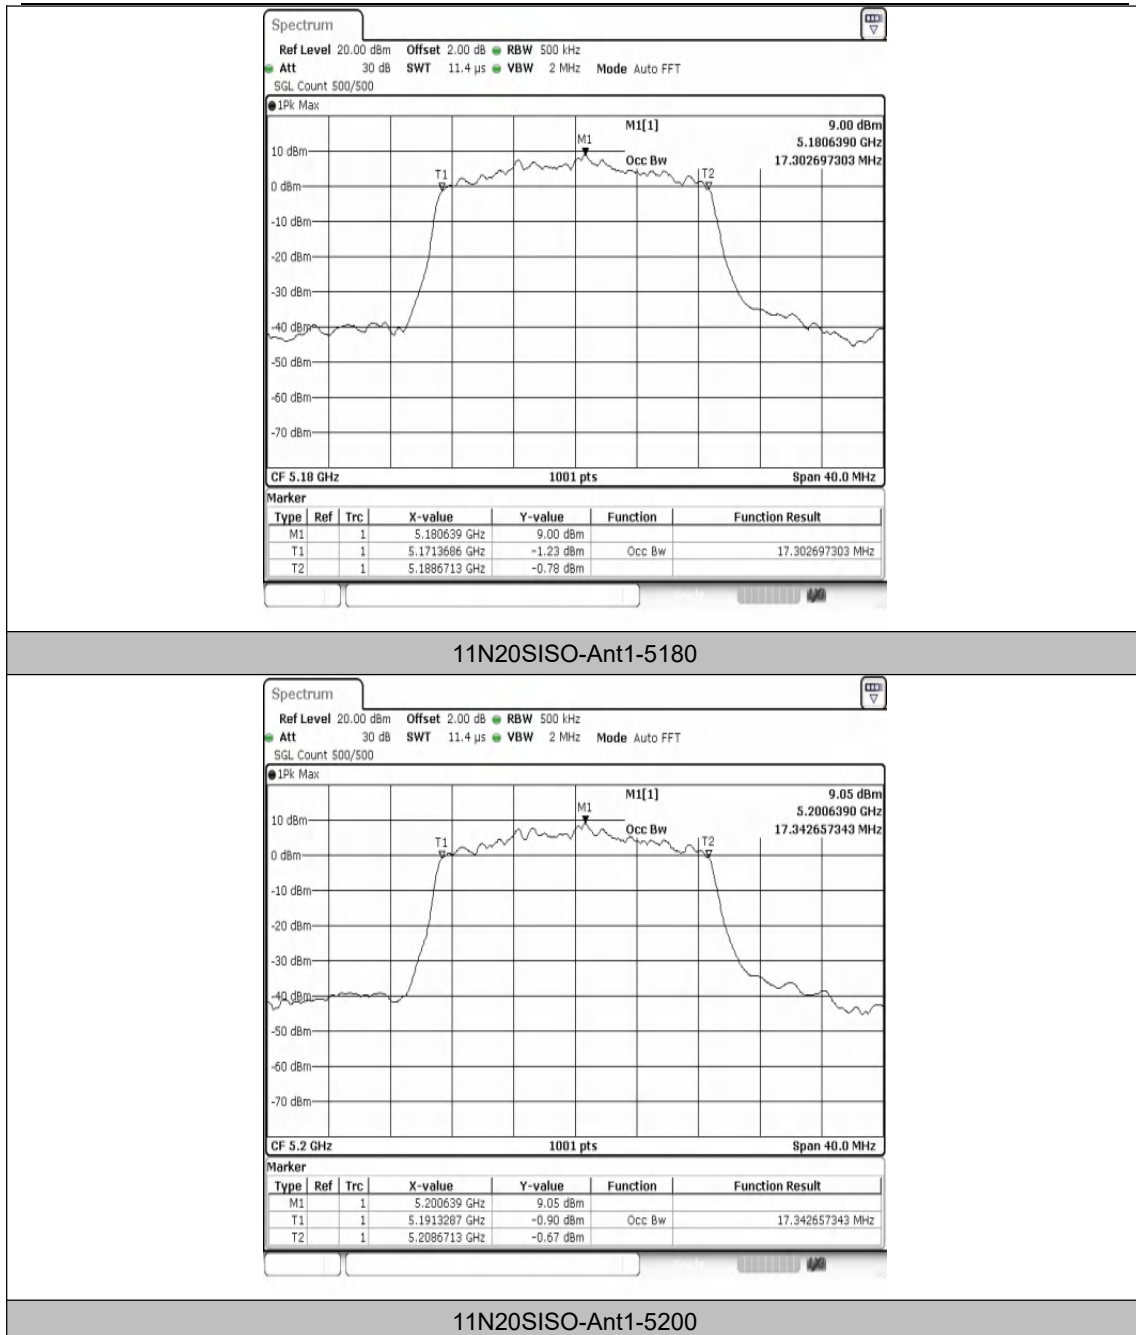





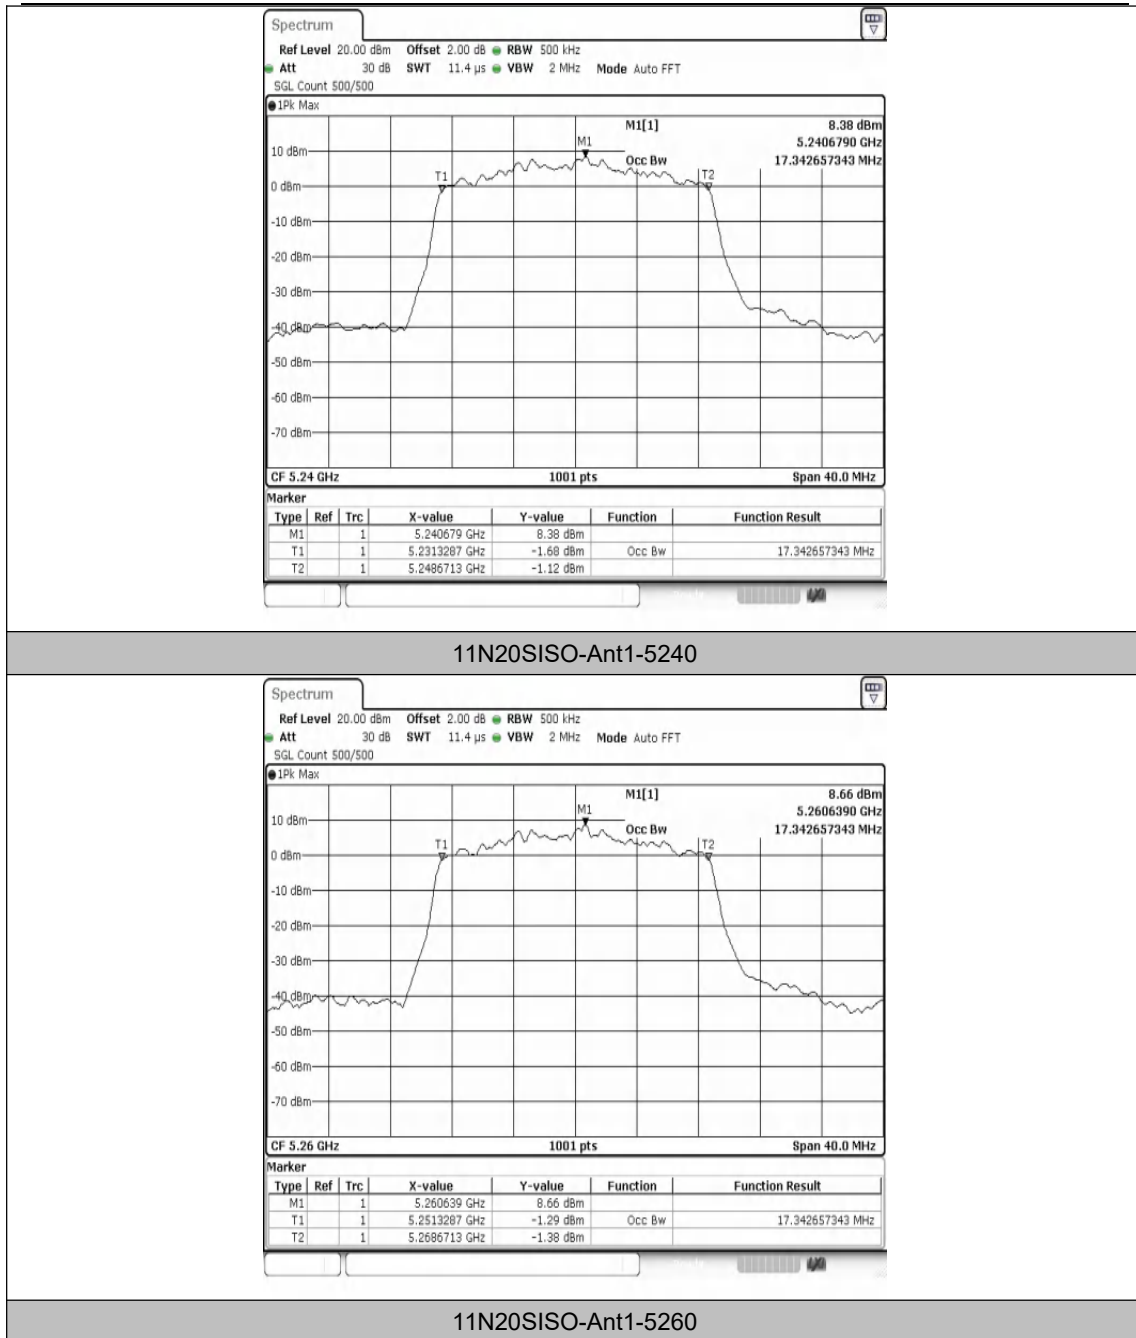


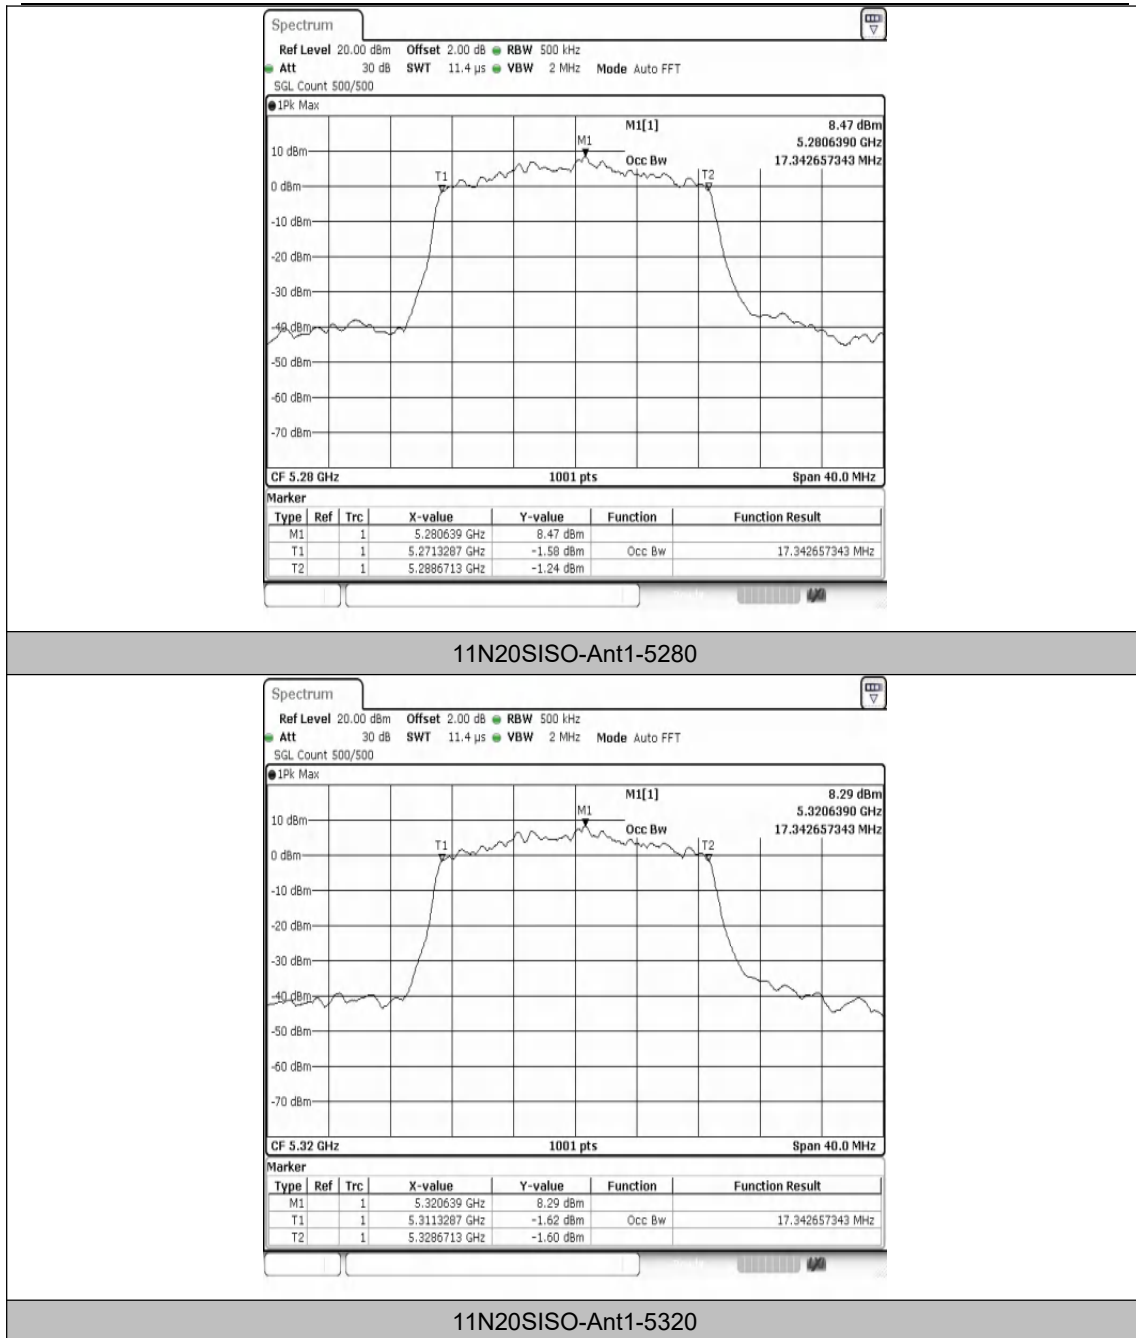

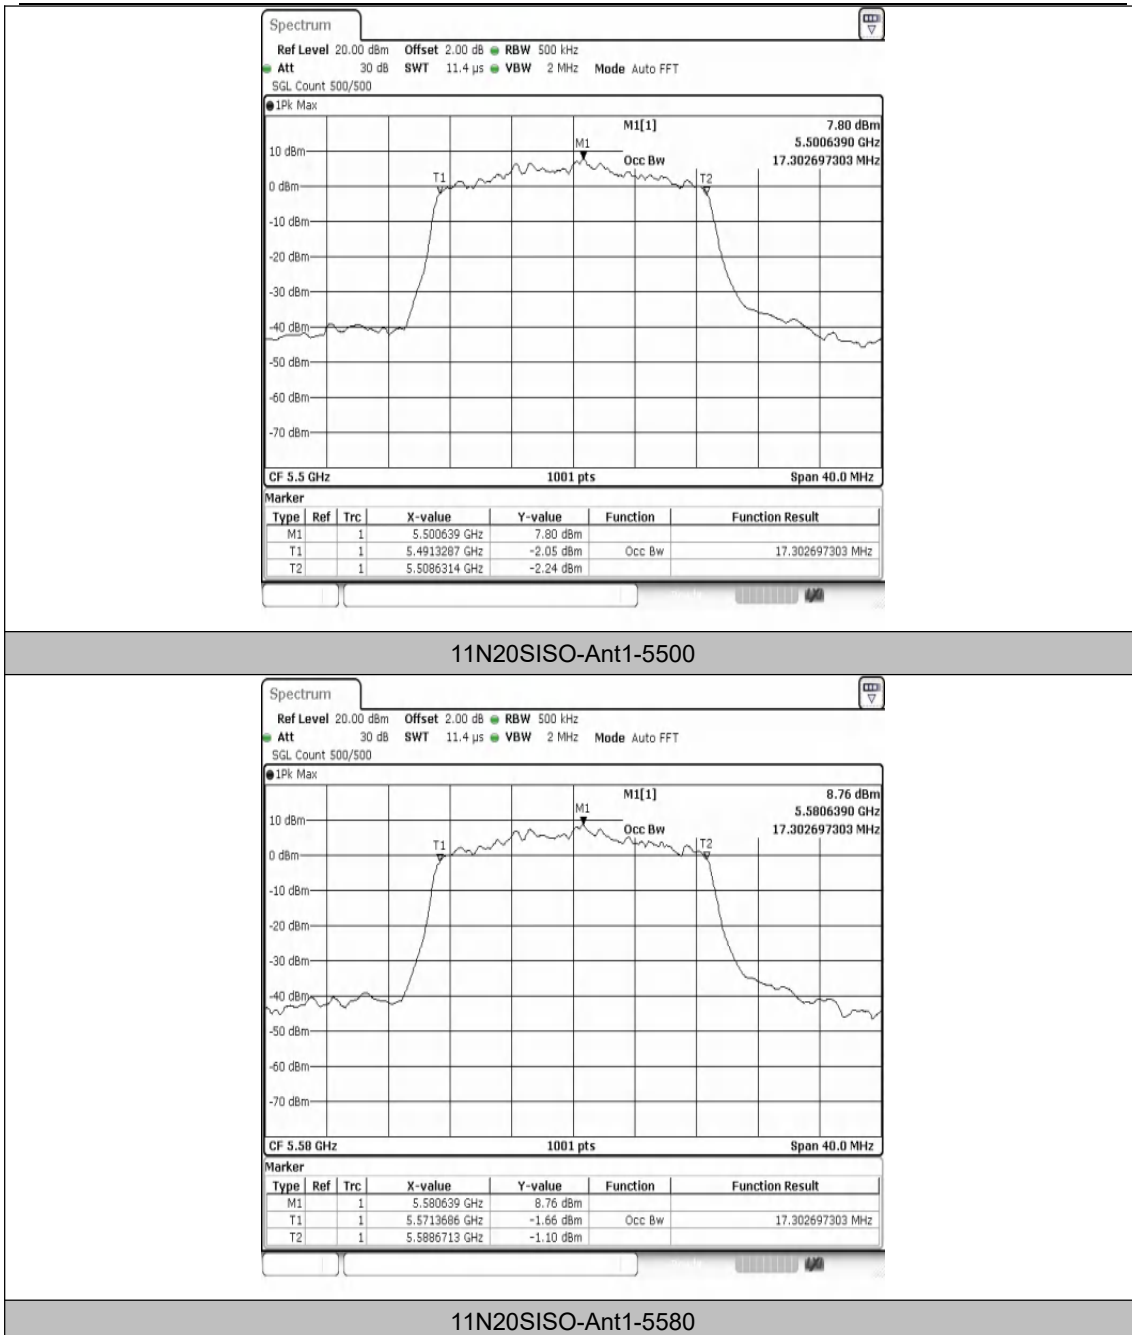


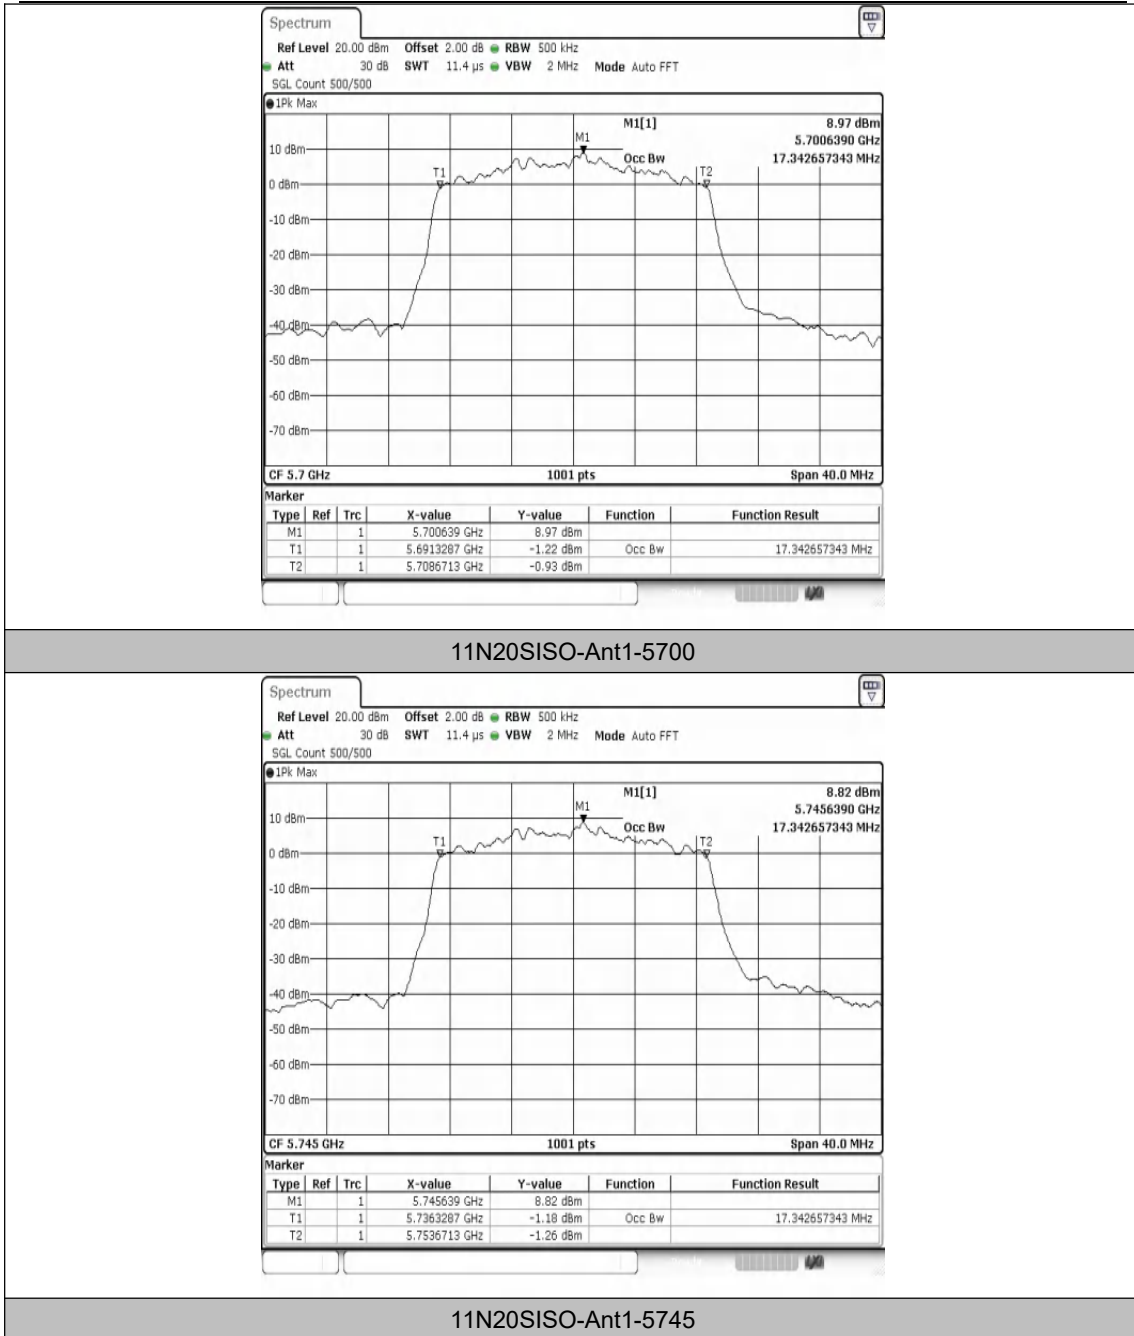


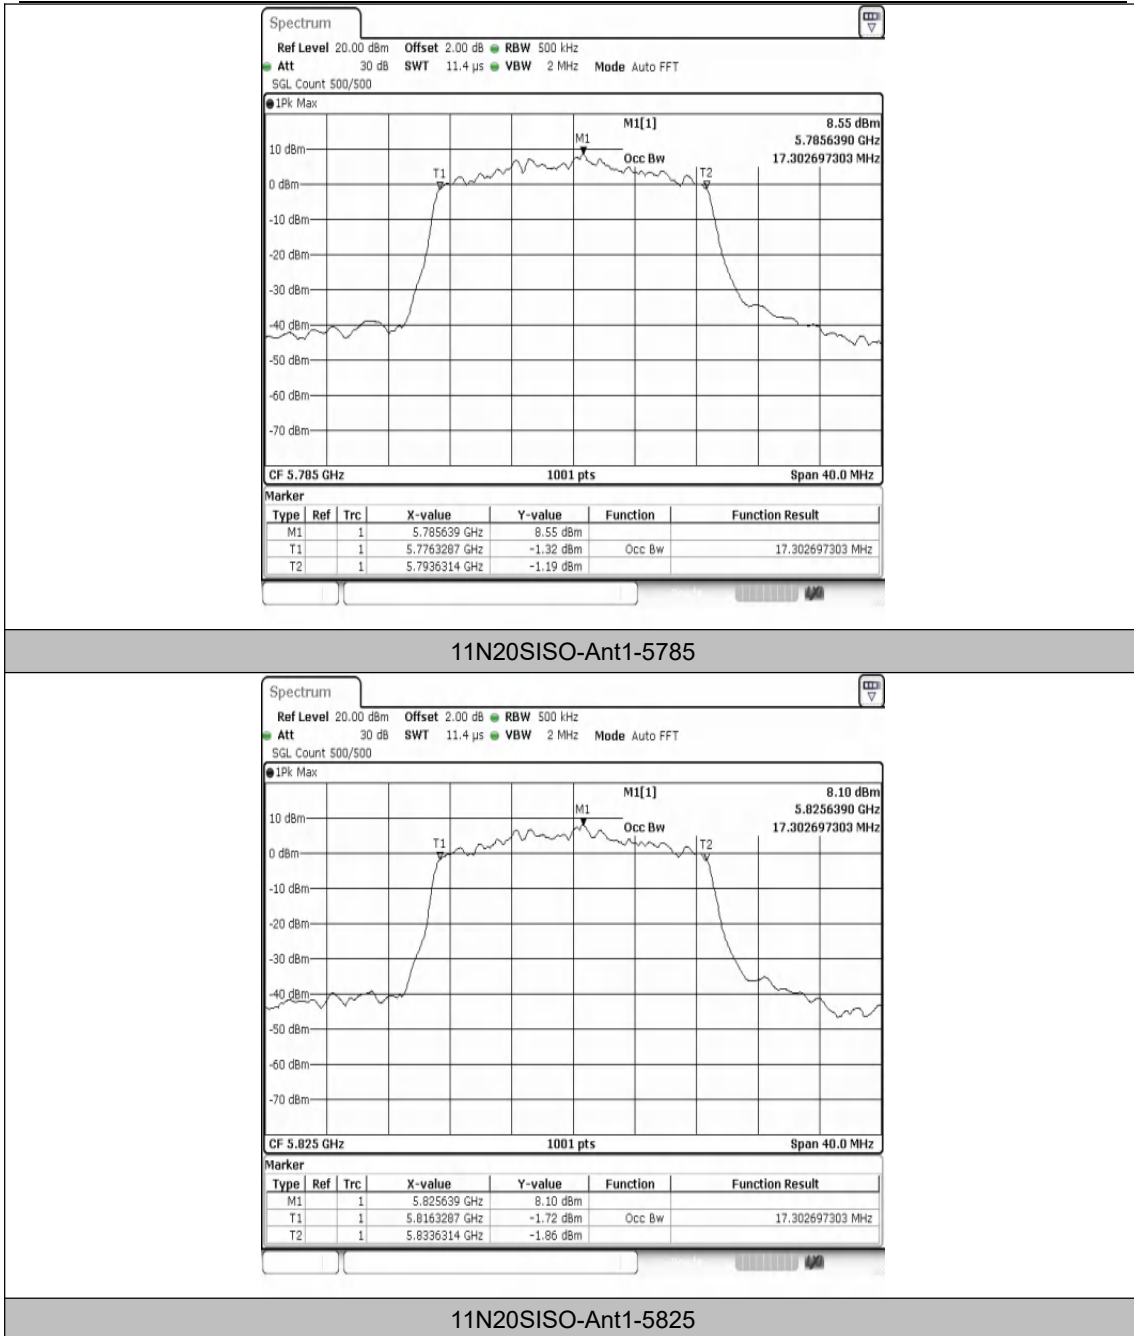


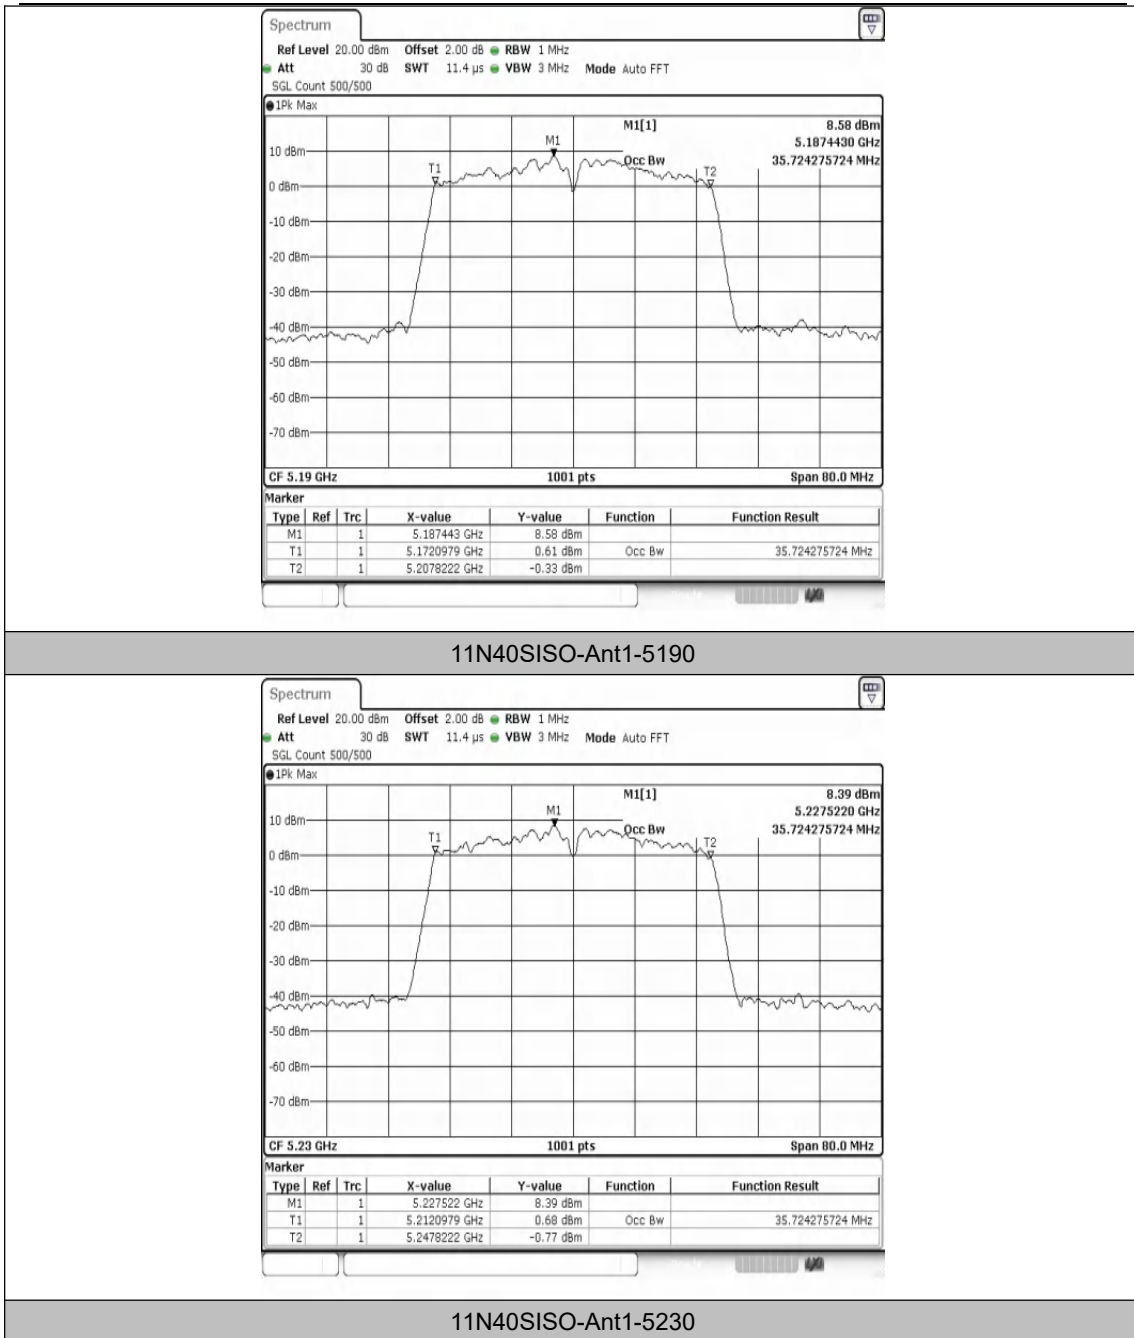





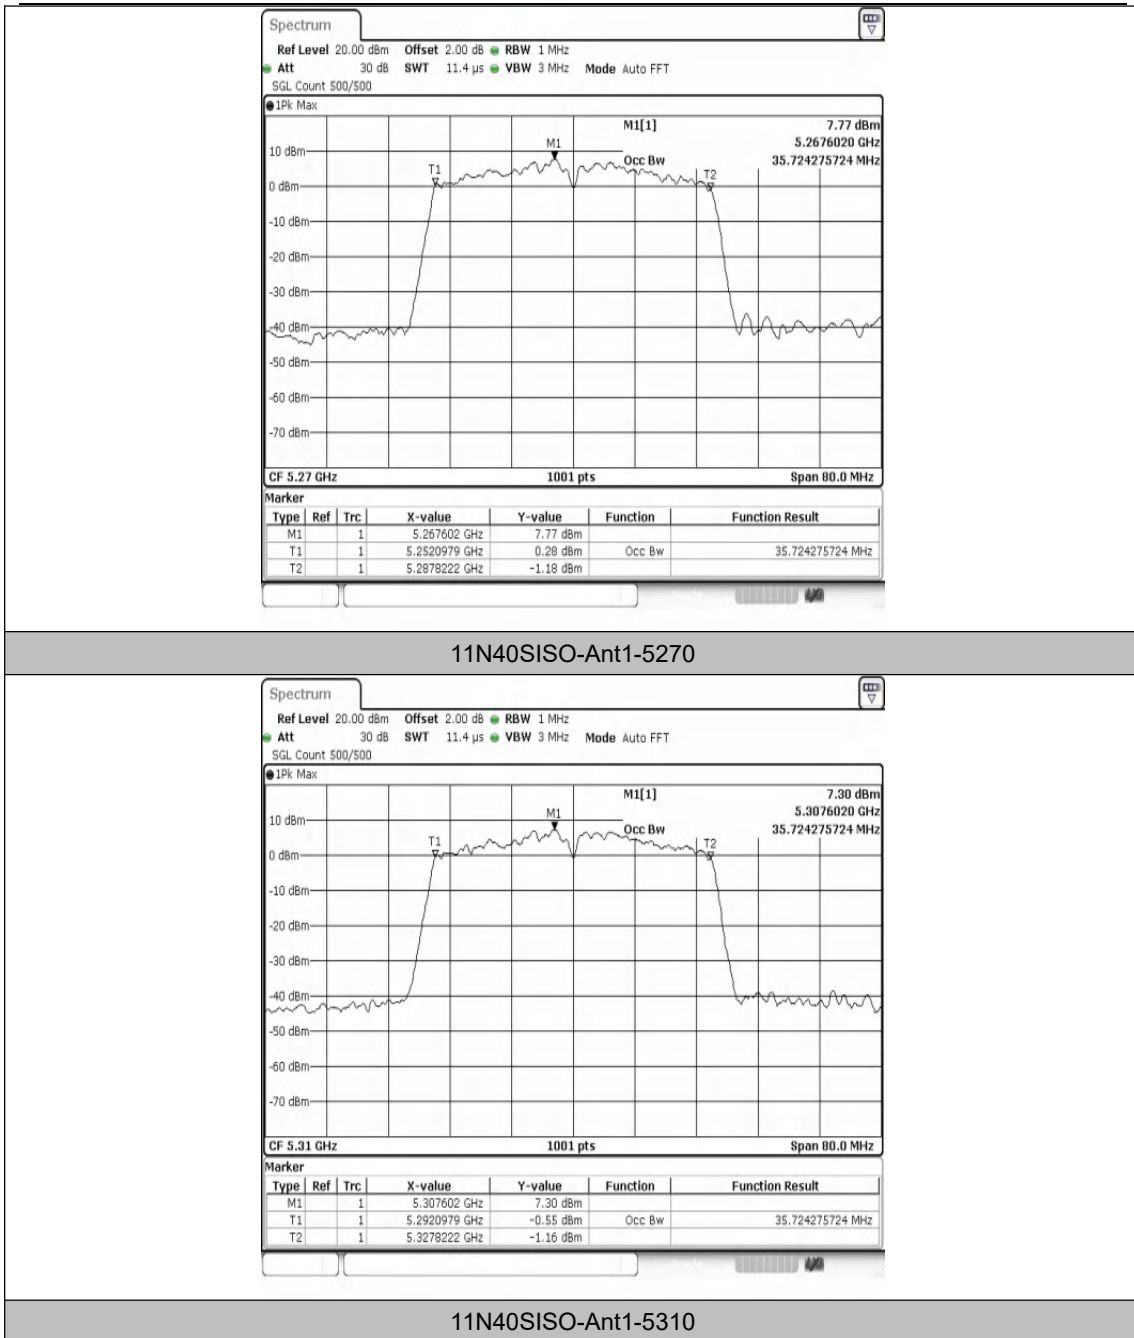

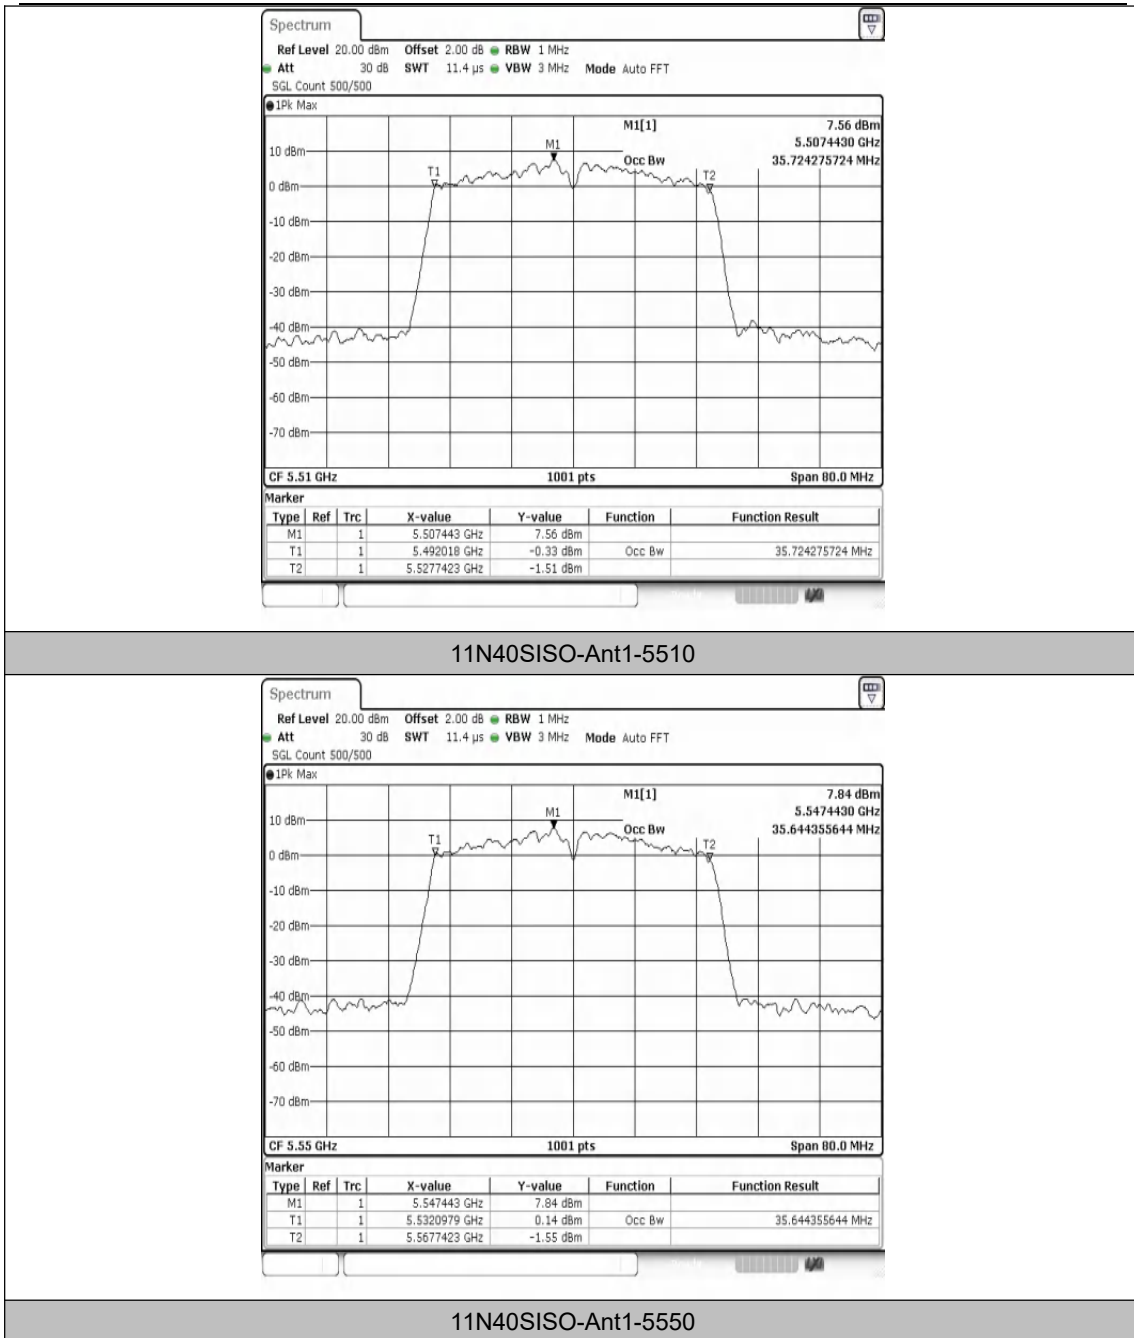

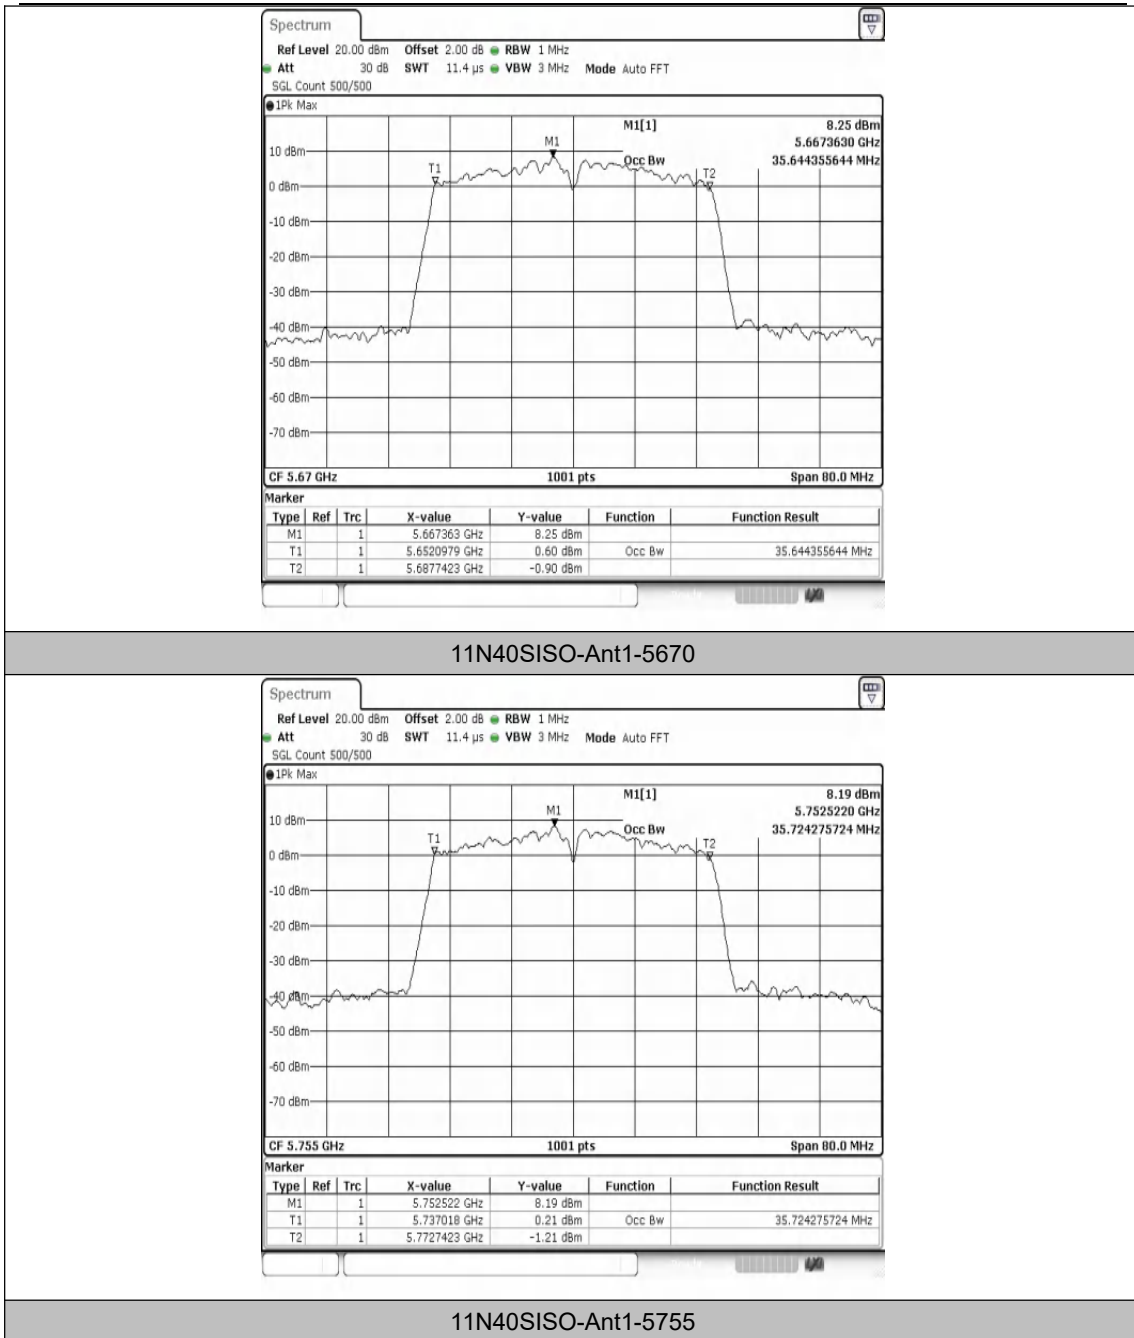

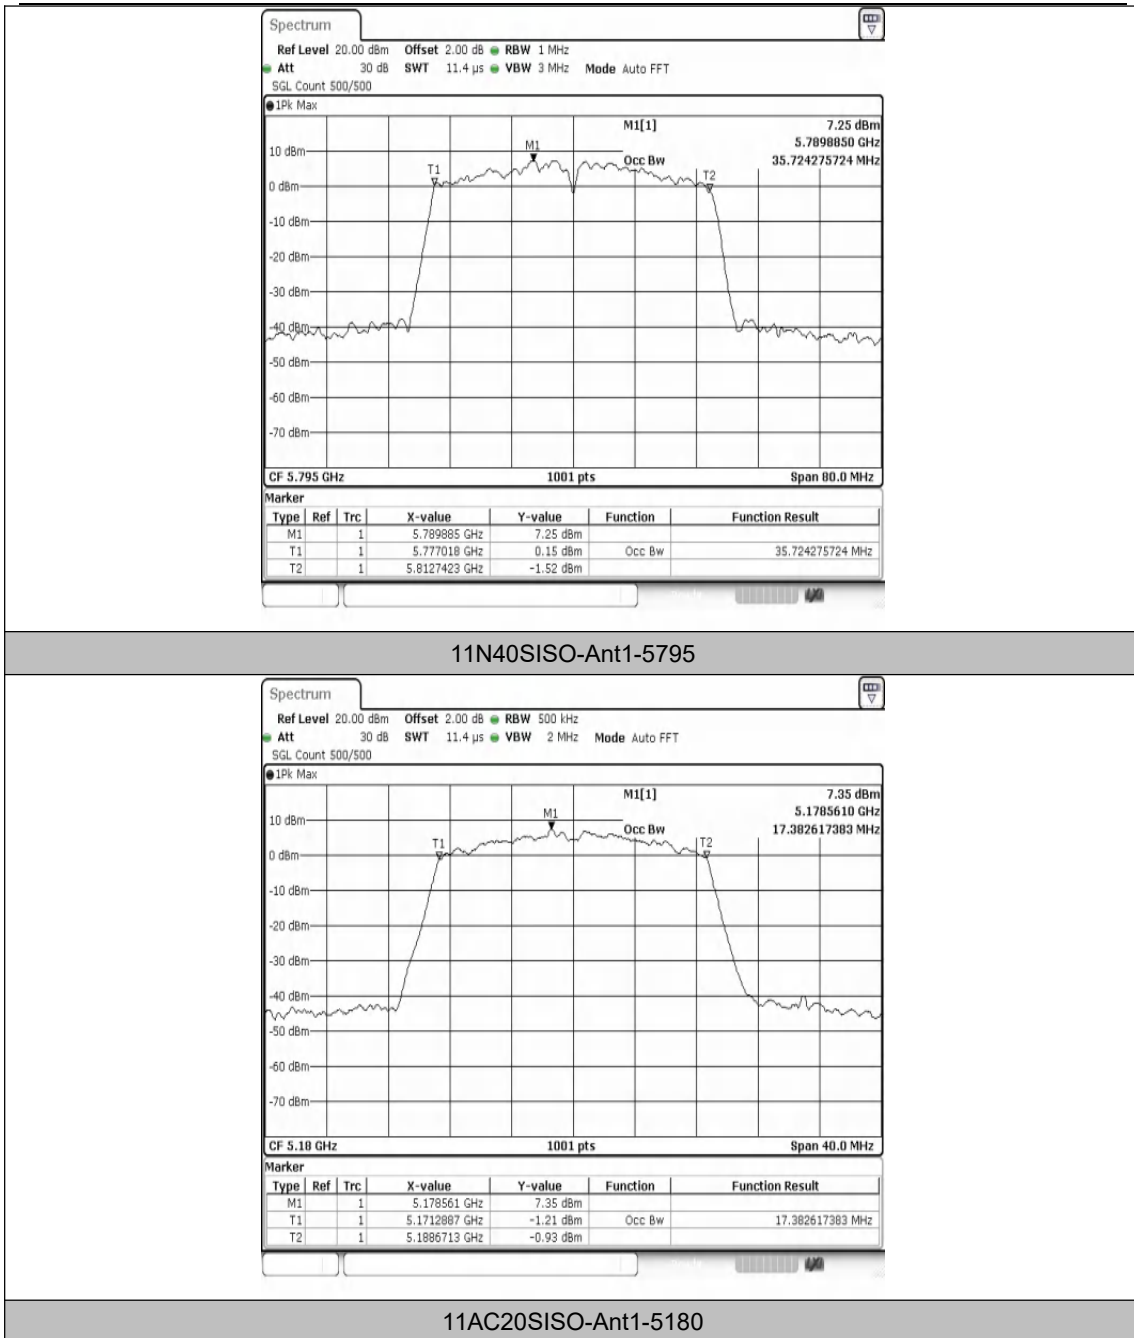


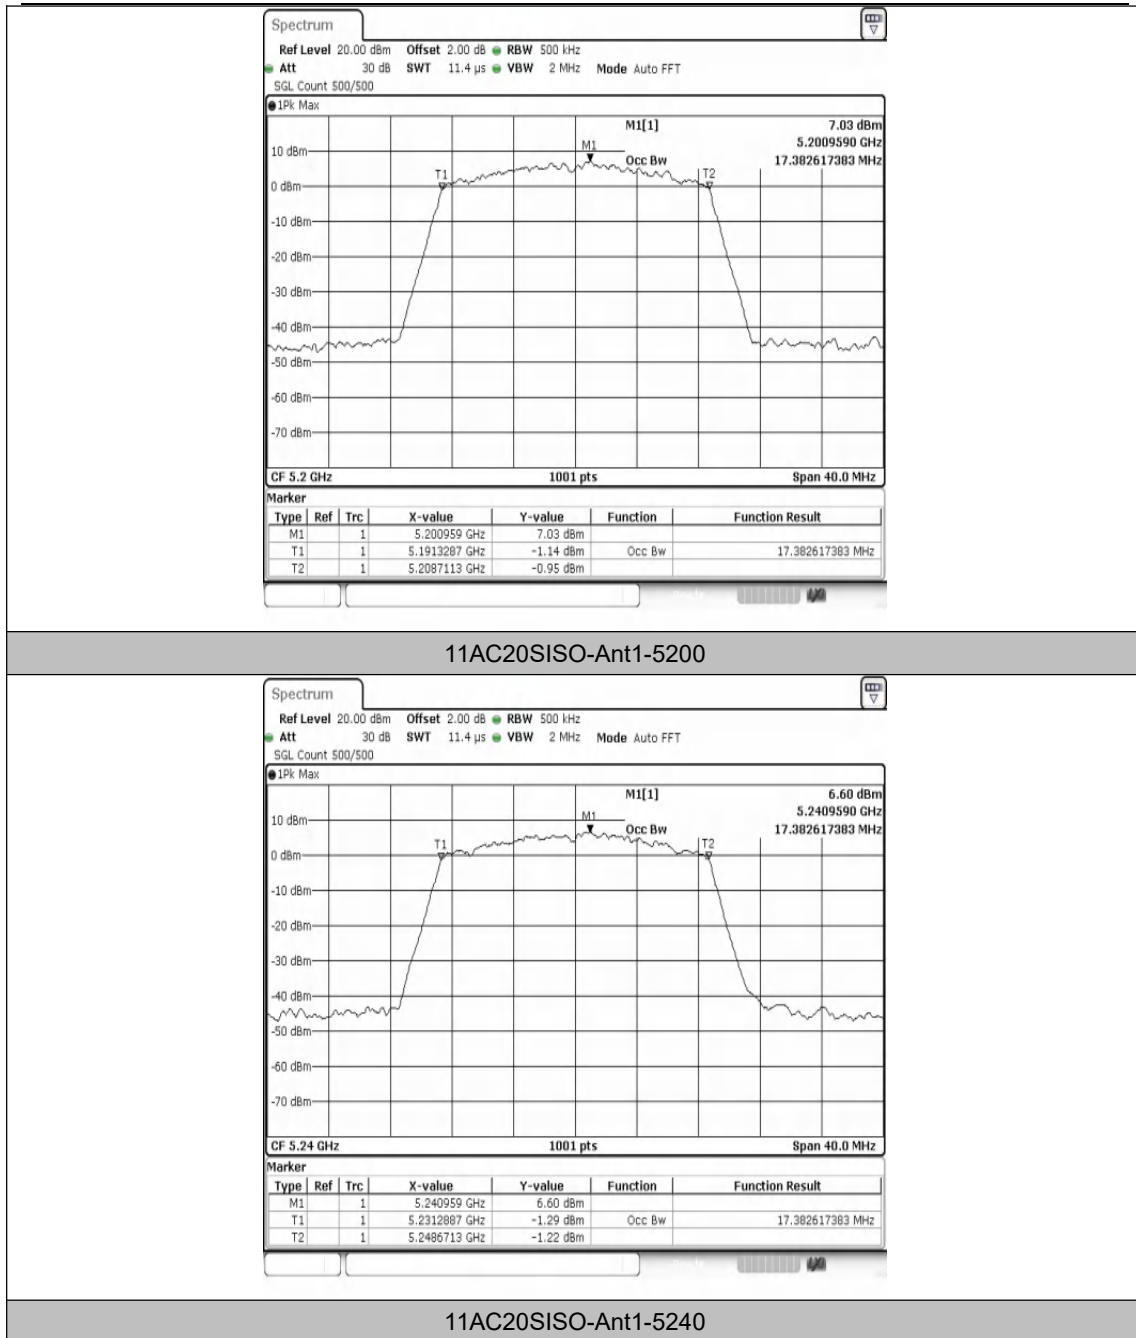


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

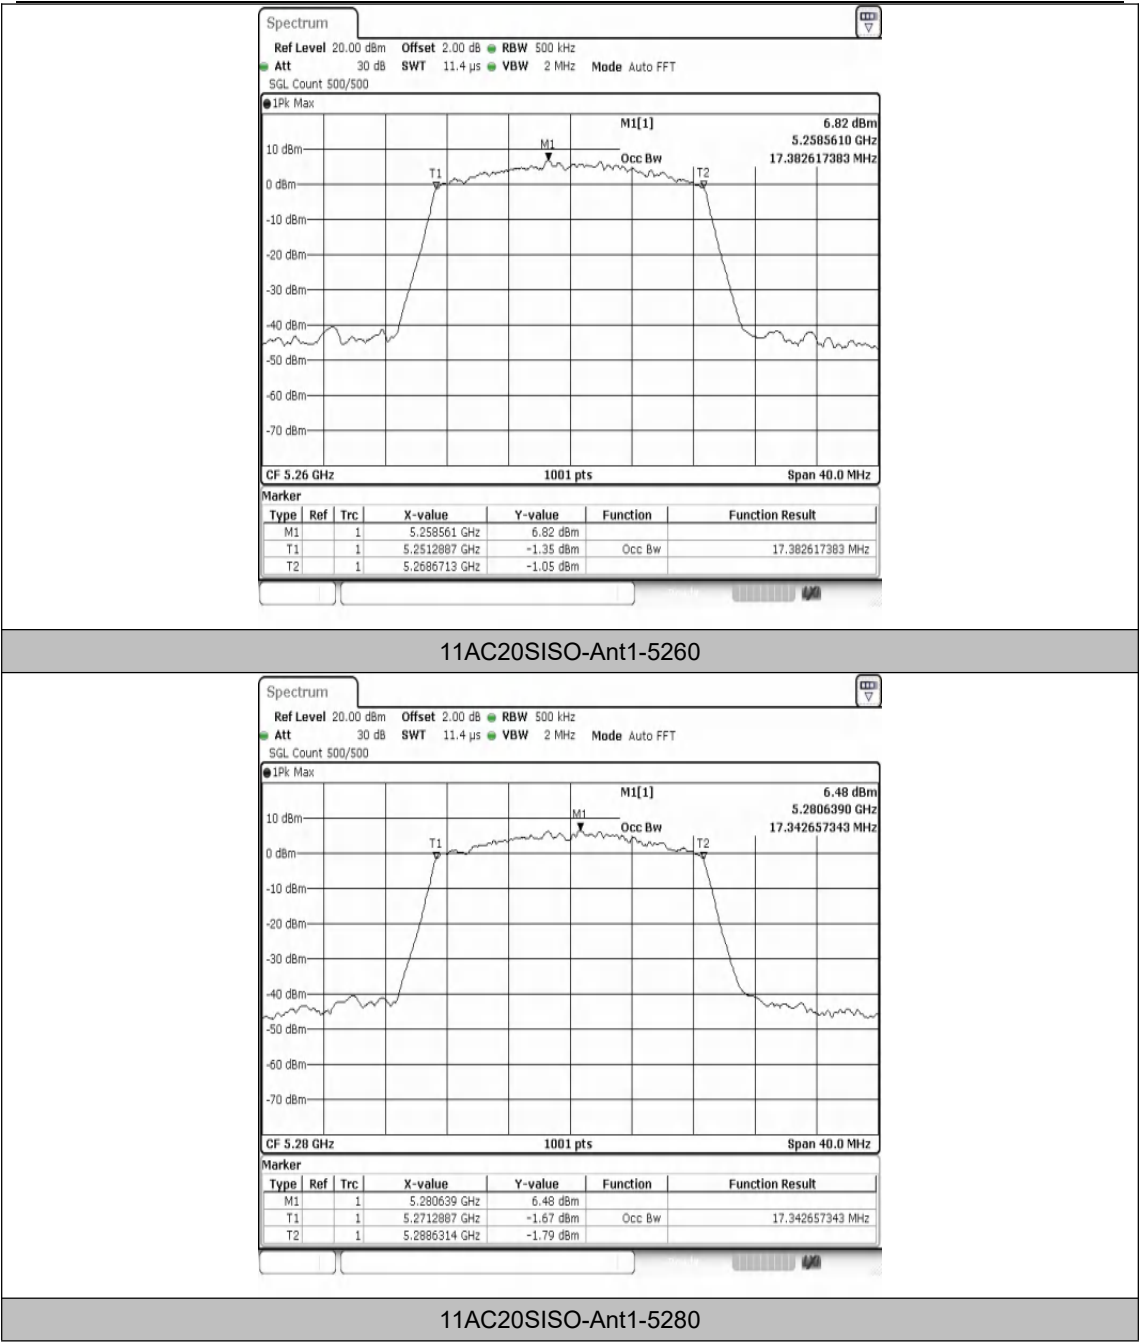




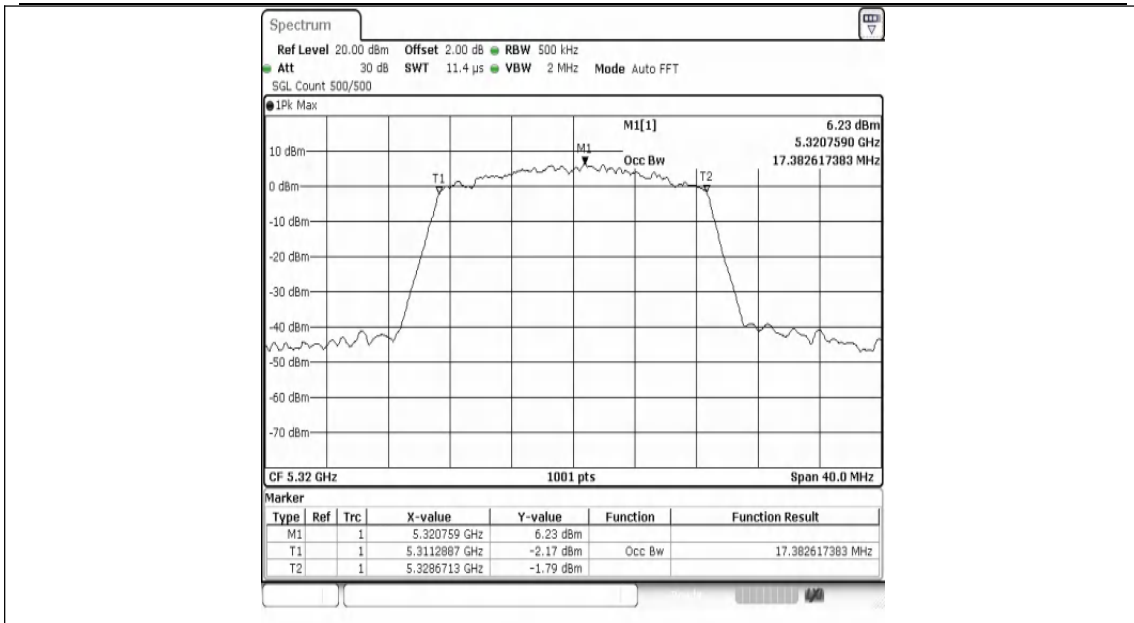


11AC20SISO-Ant1-5320

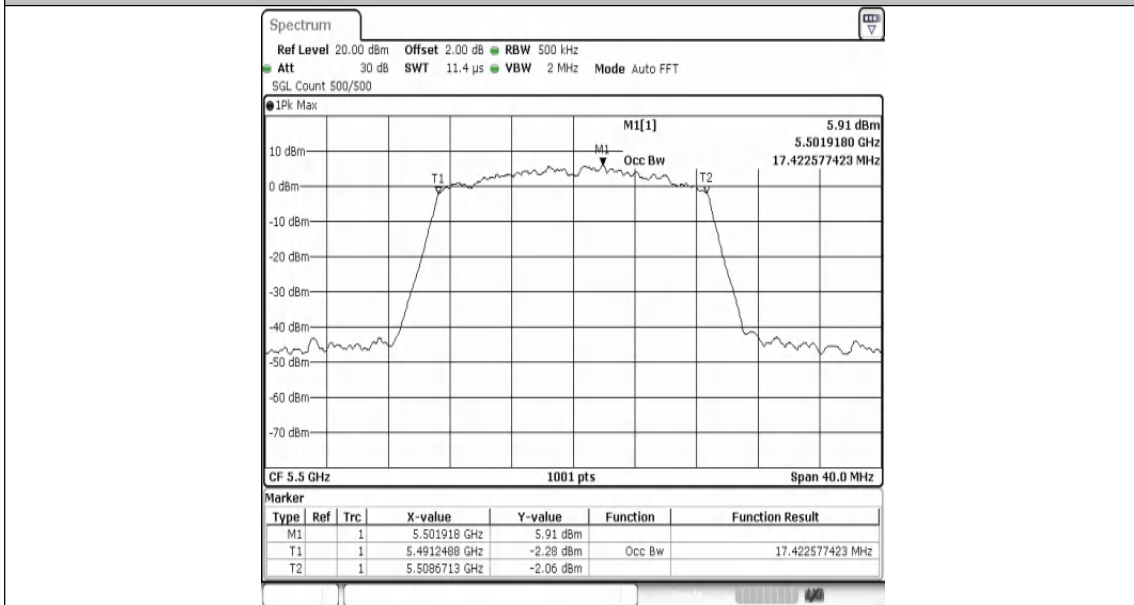


11AC20SISO-Ant1-5500

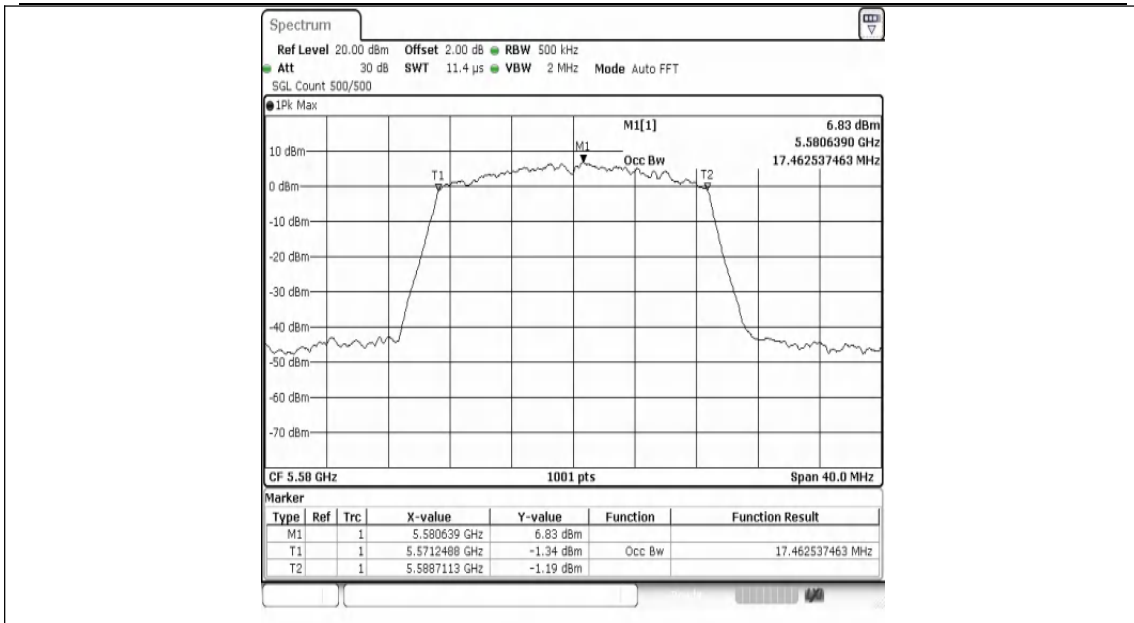


11AC20SISO-Ant1-5580

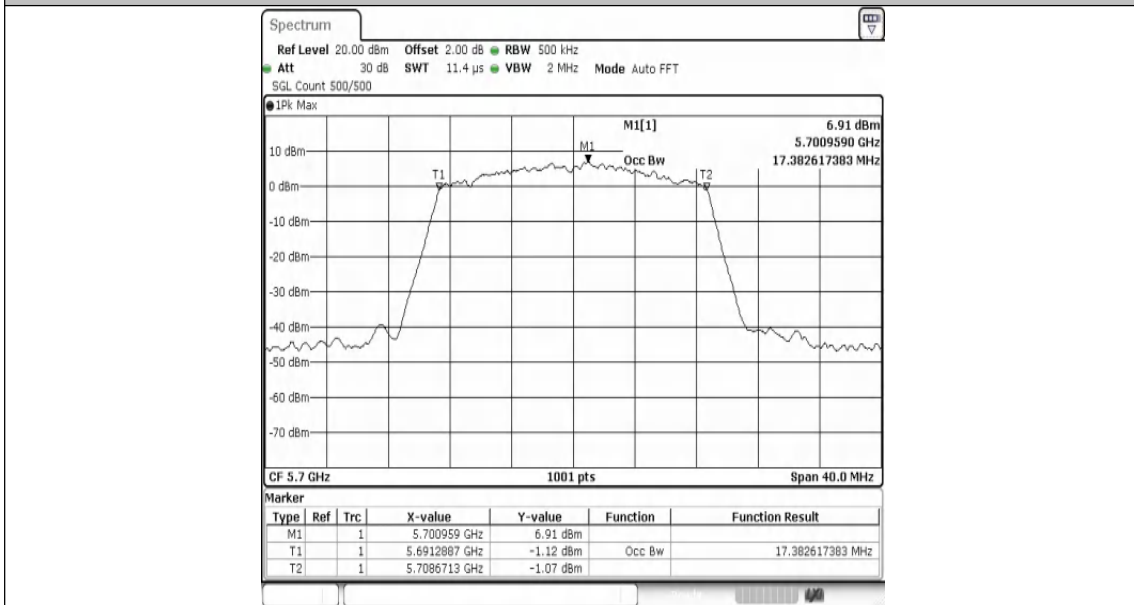


11AC20SISO-Ant1-5700

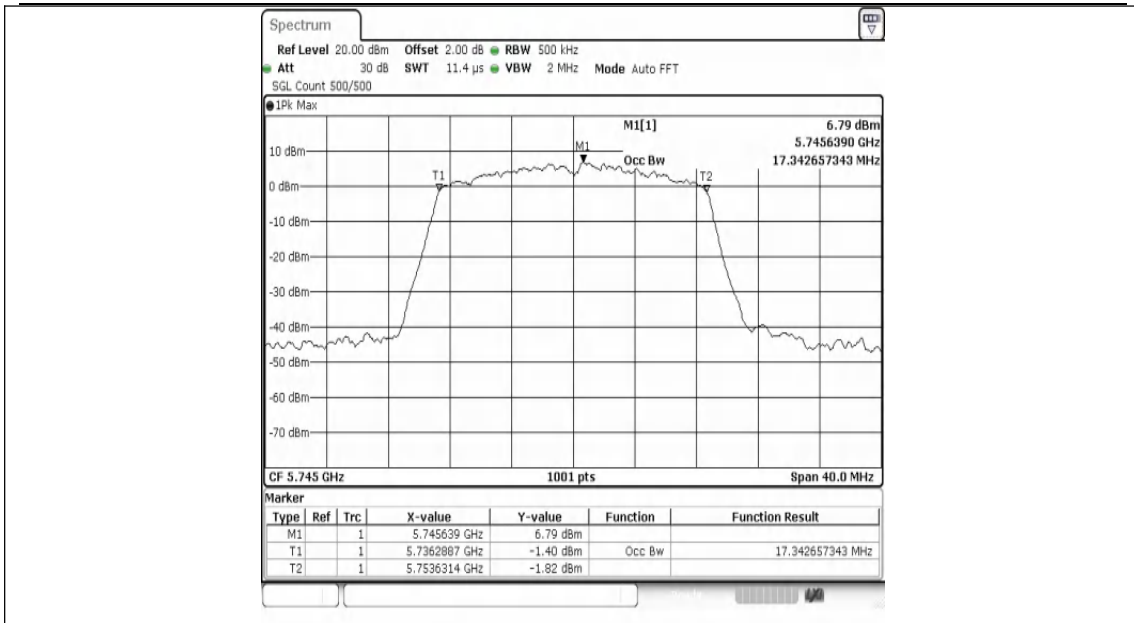


11AC20SISO-Ant1-5745

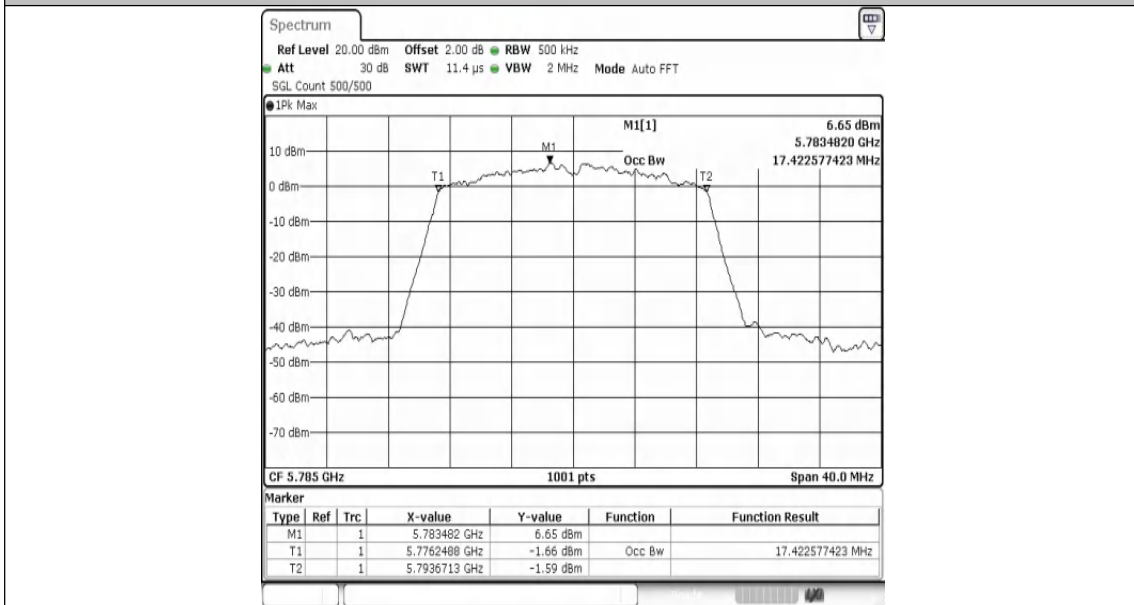


11AC20SISO-Ant1-5785

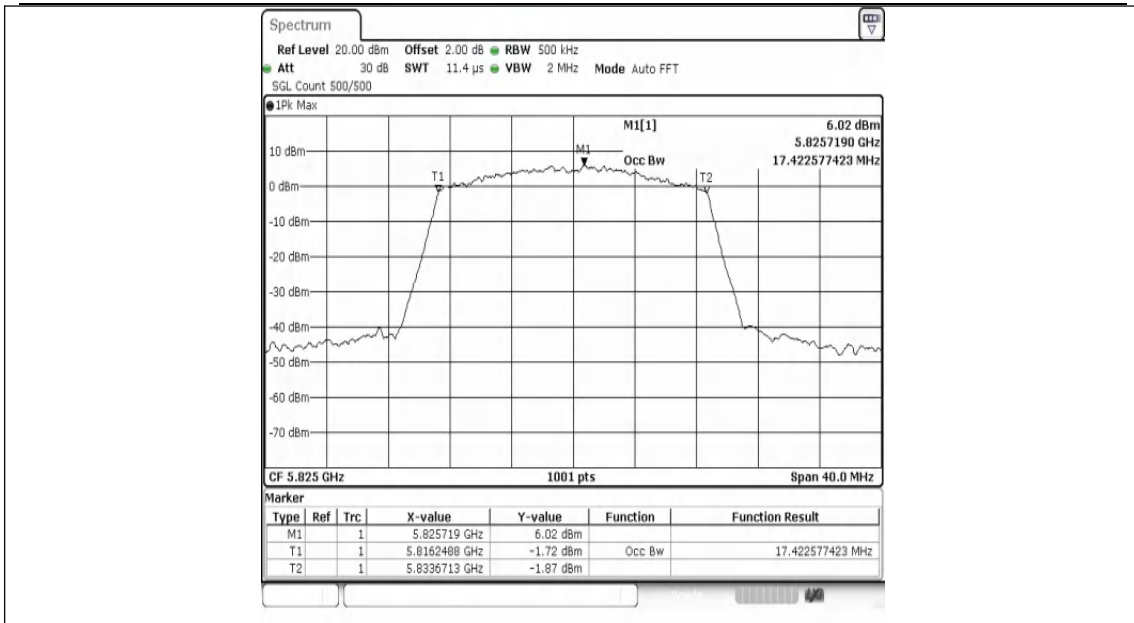


11AC20SISO-Ant1-5825

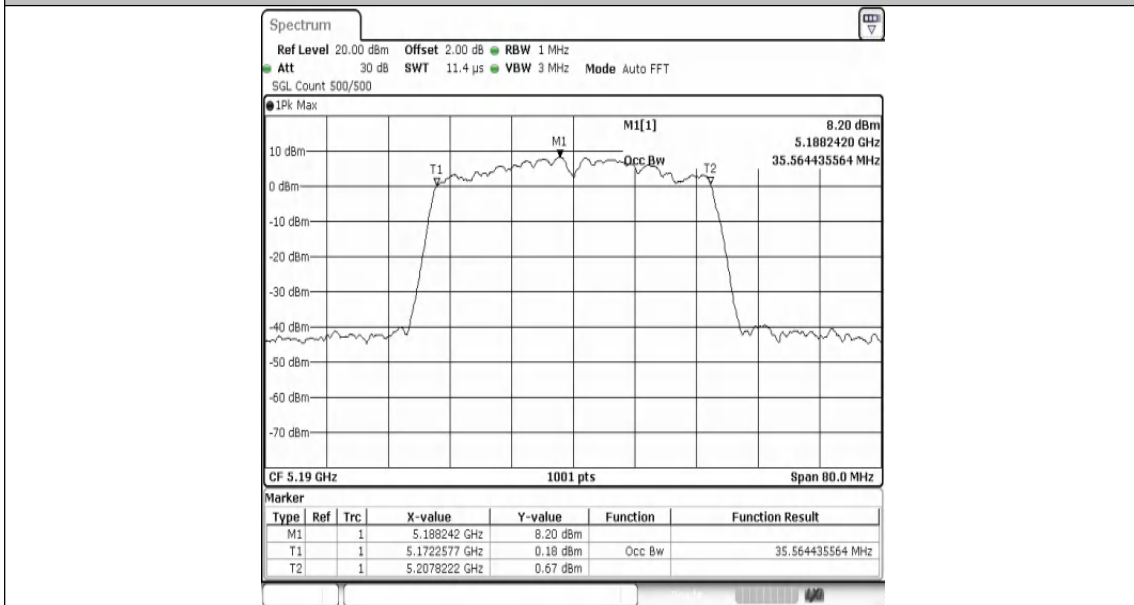


11AC40SISO-Ant1-5190

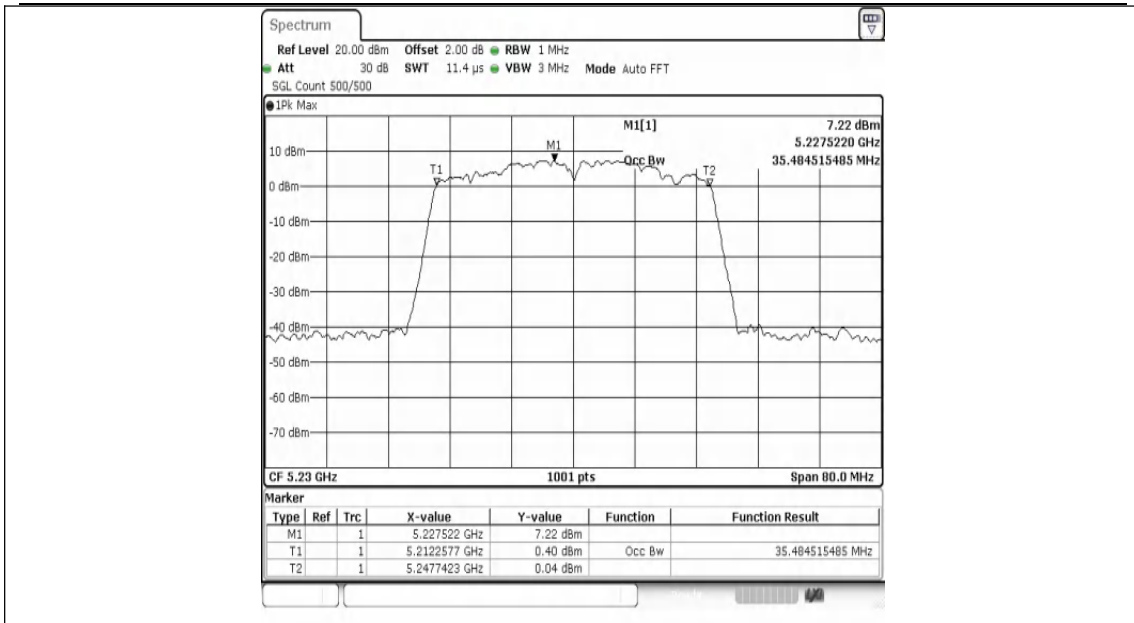


11AC40SISO-Ant1-5230

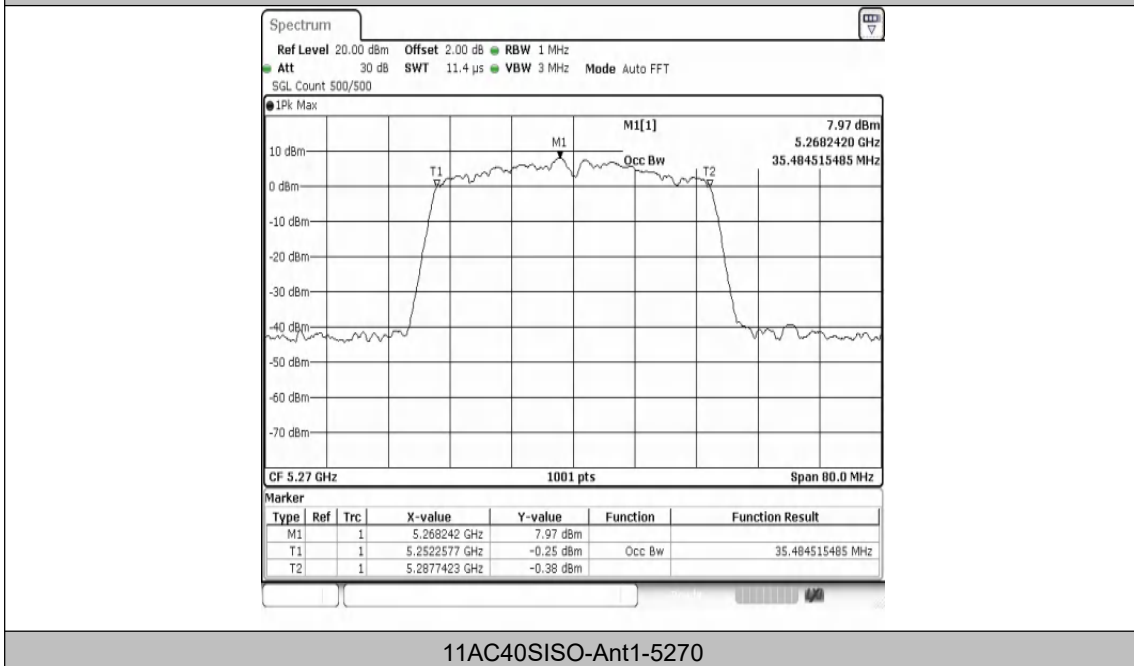

11AC40SISO-Ant1-5270

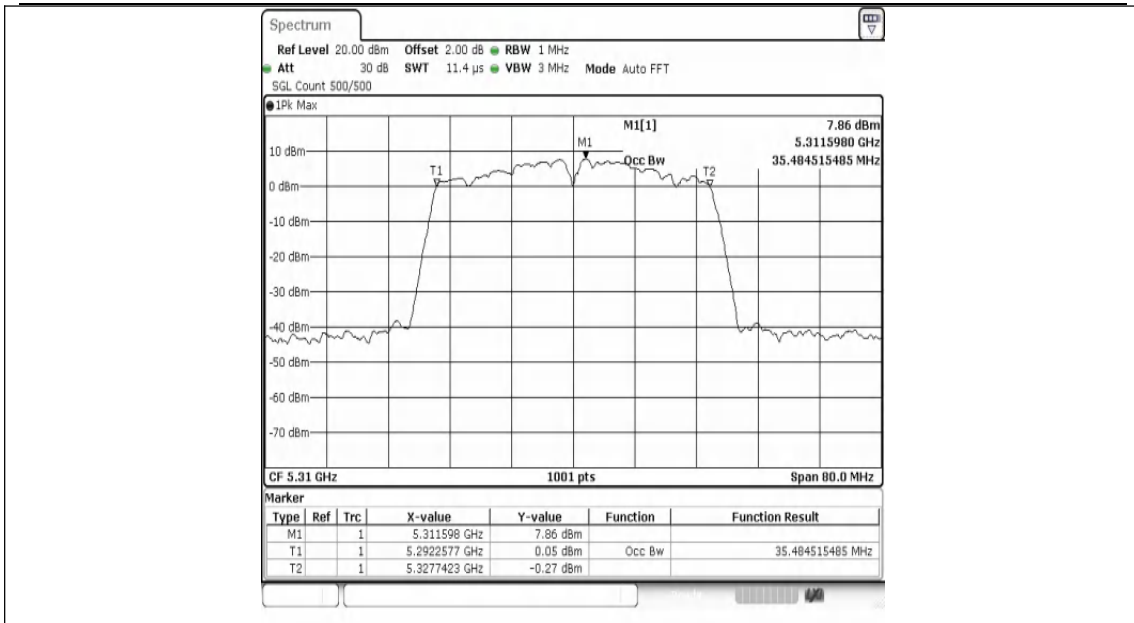


11AC40SISO-Ant1-5310

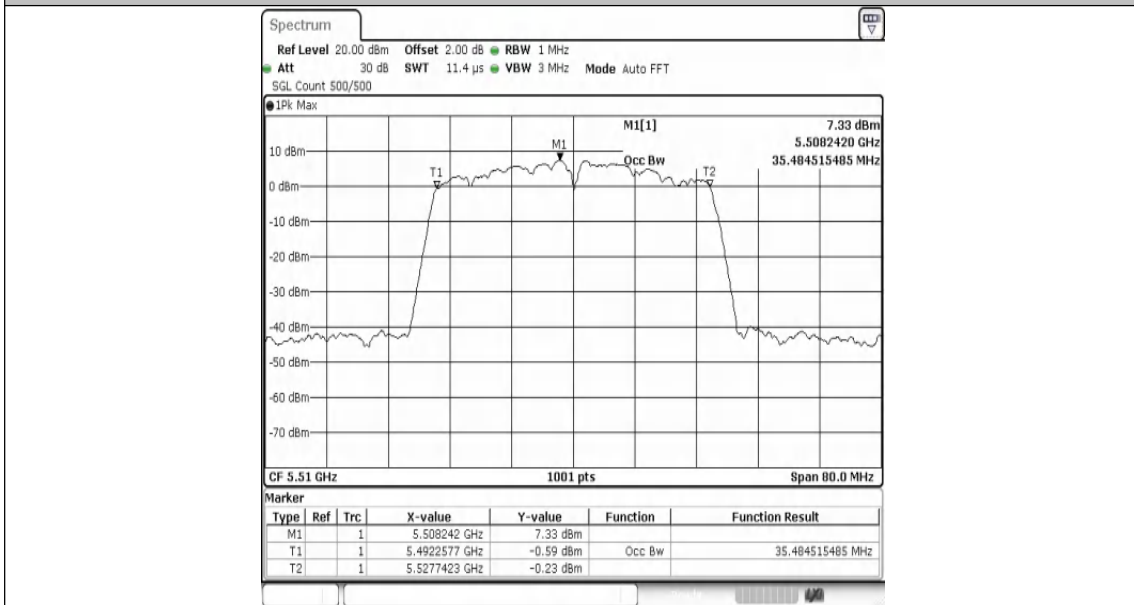

11AC40SISO-Ant1-5510




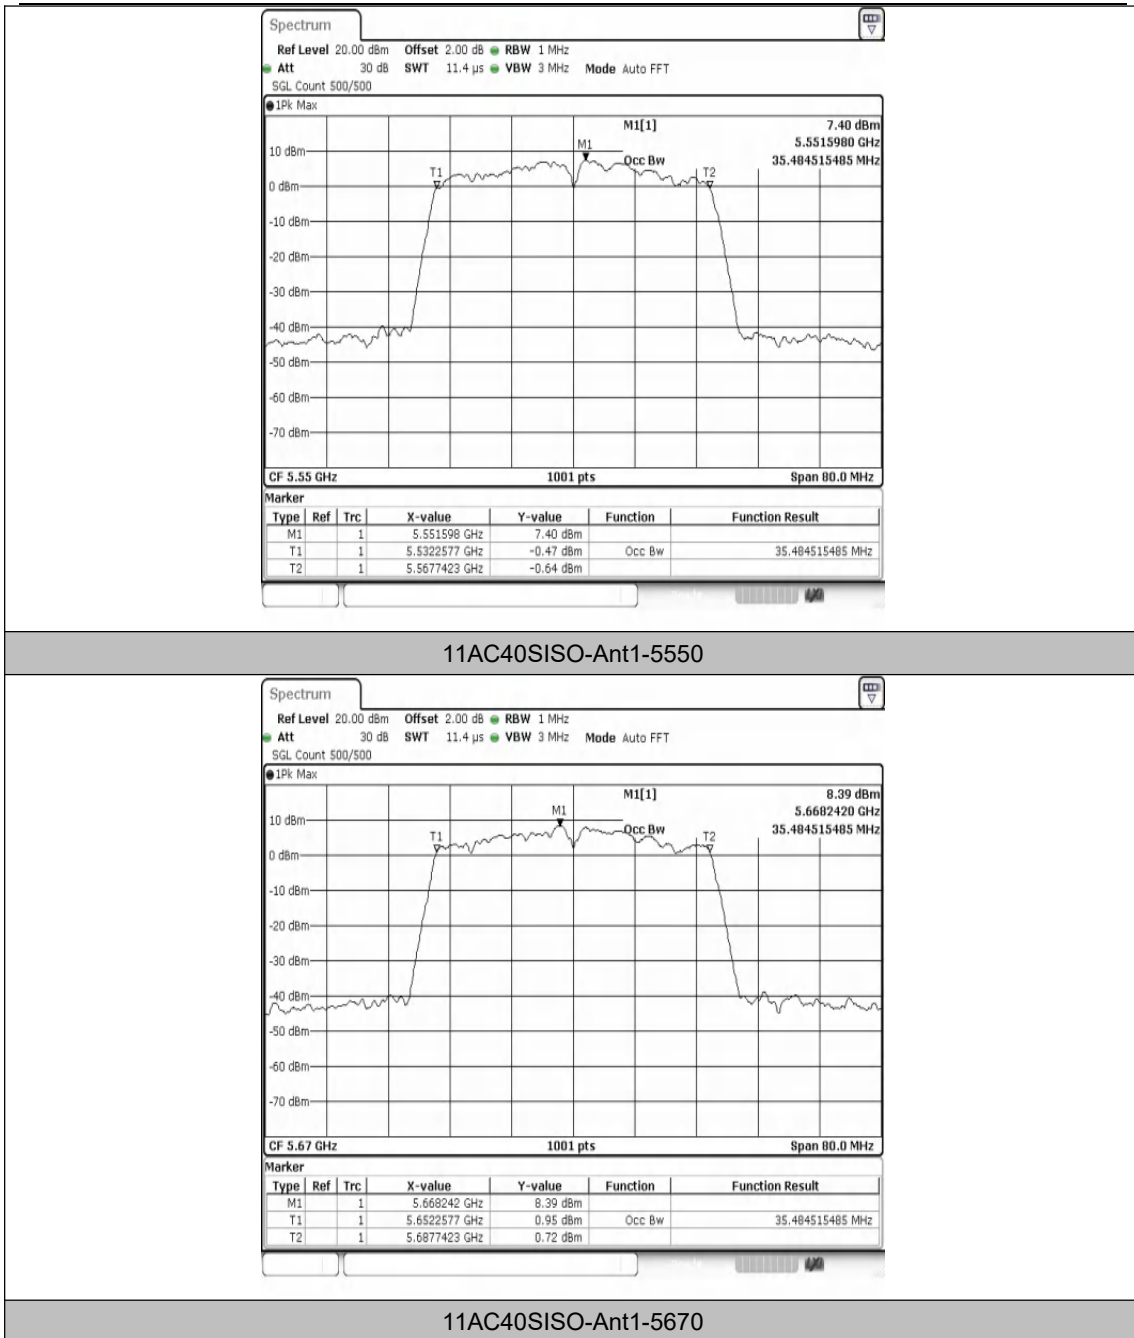



#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

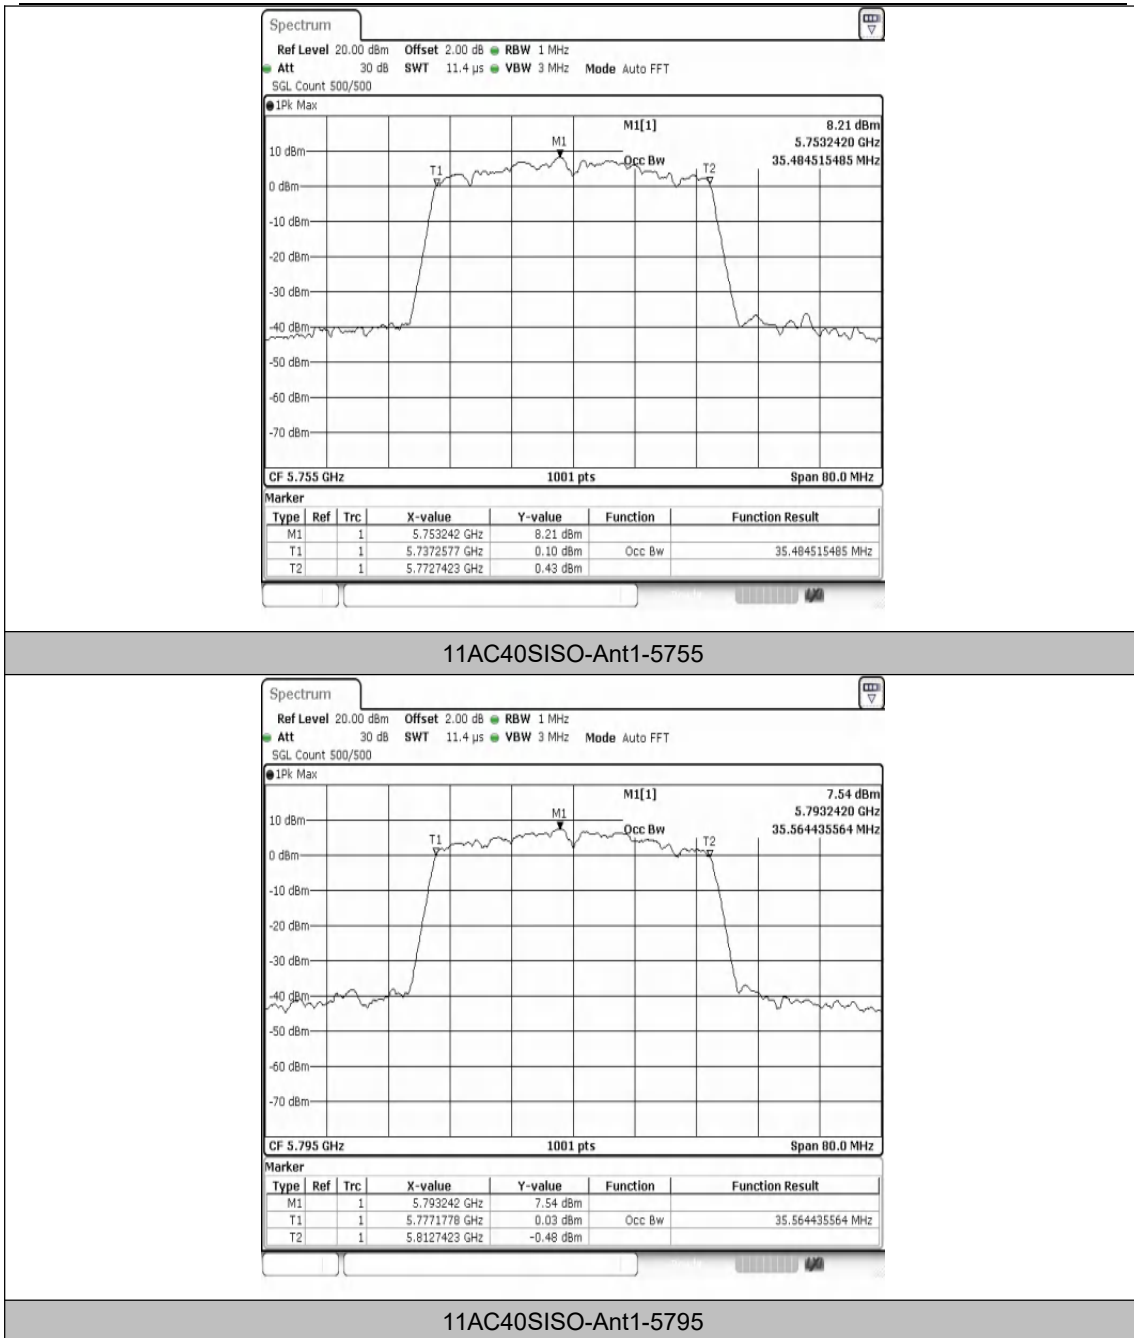

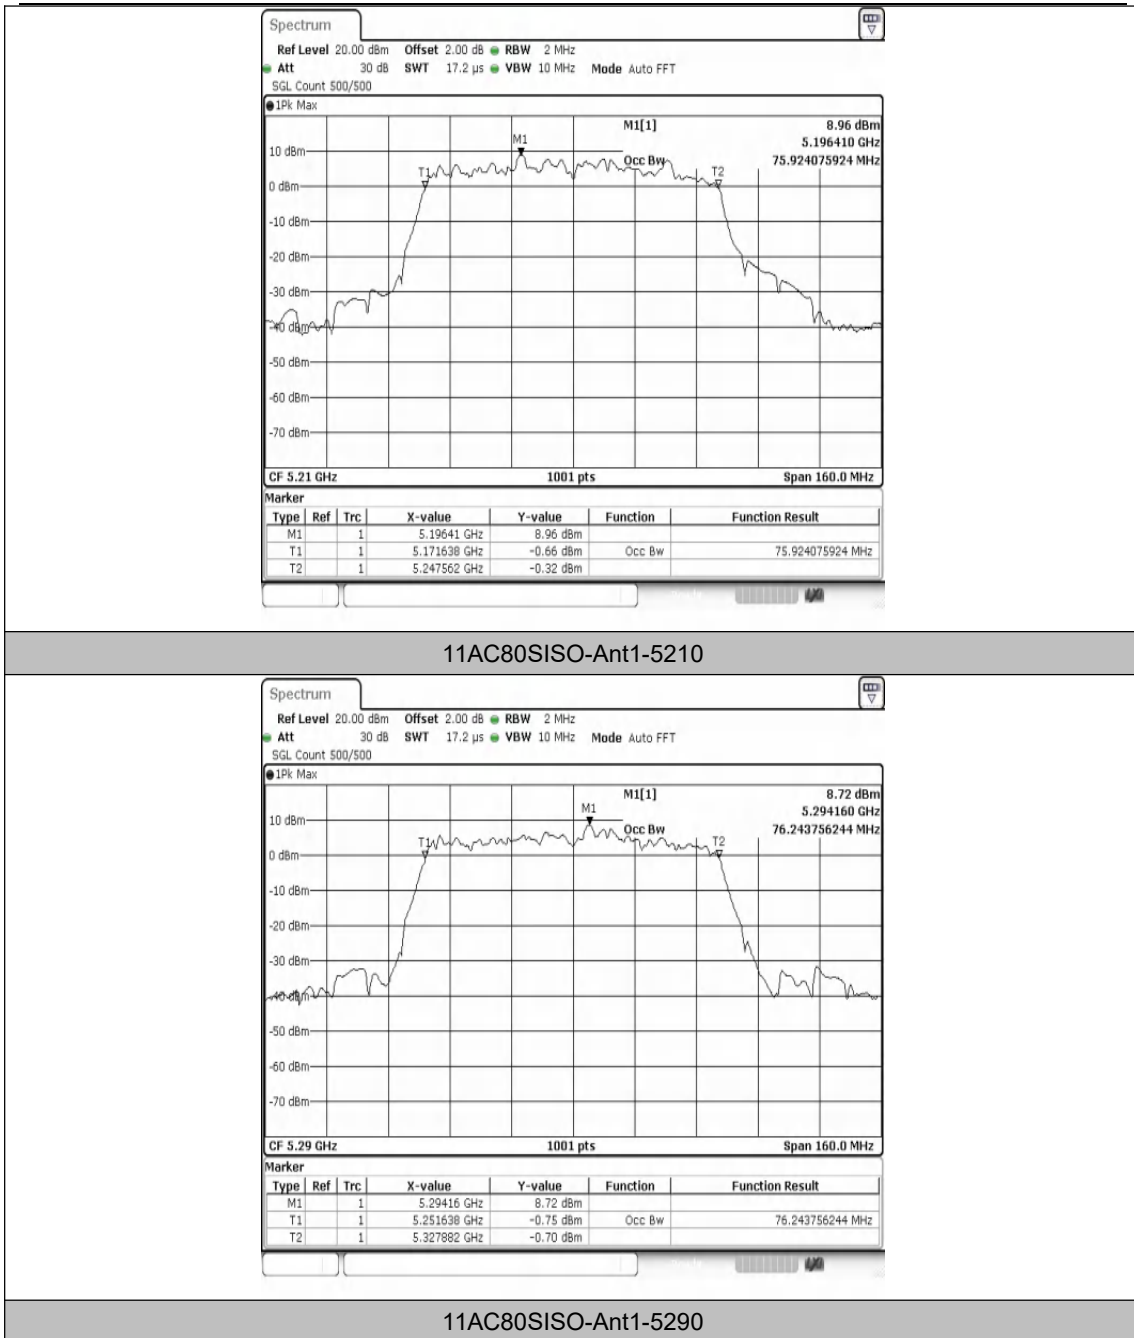

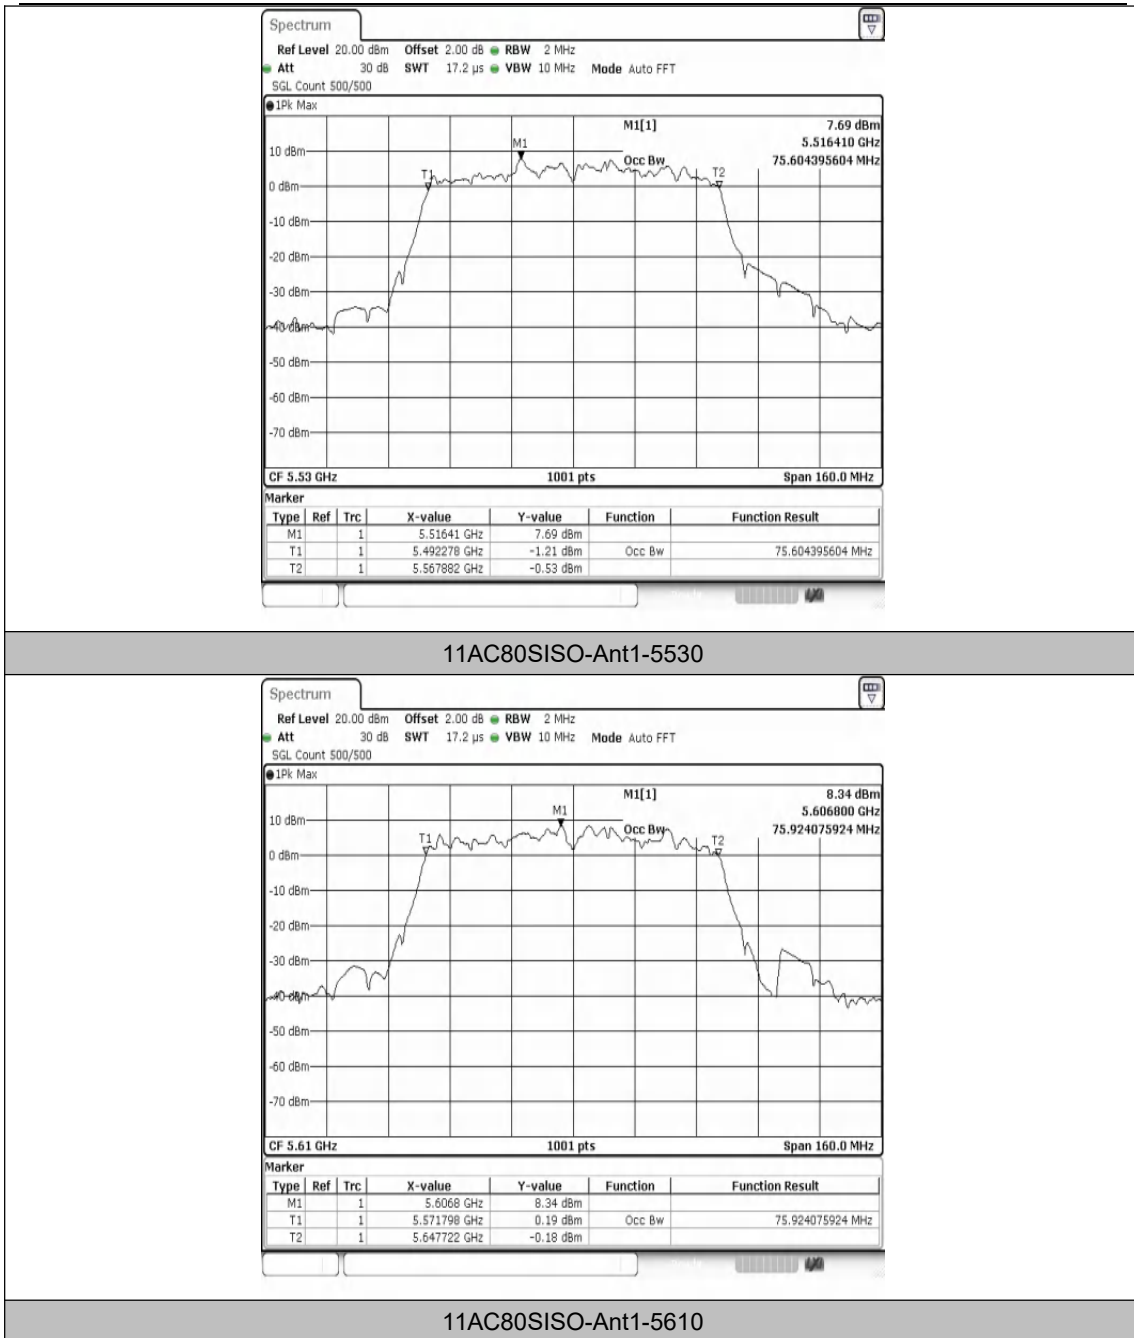

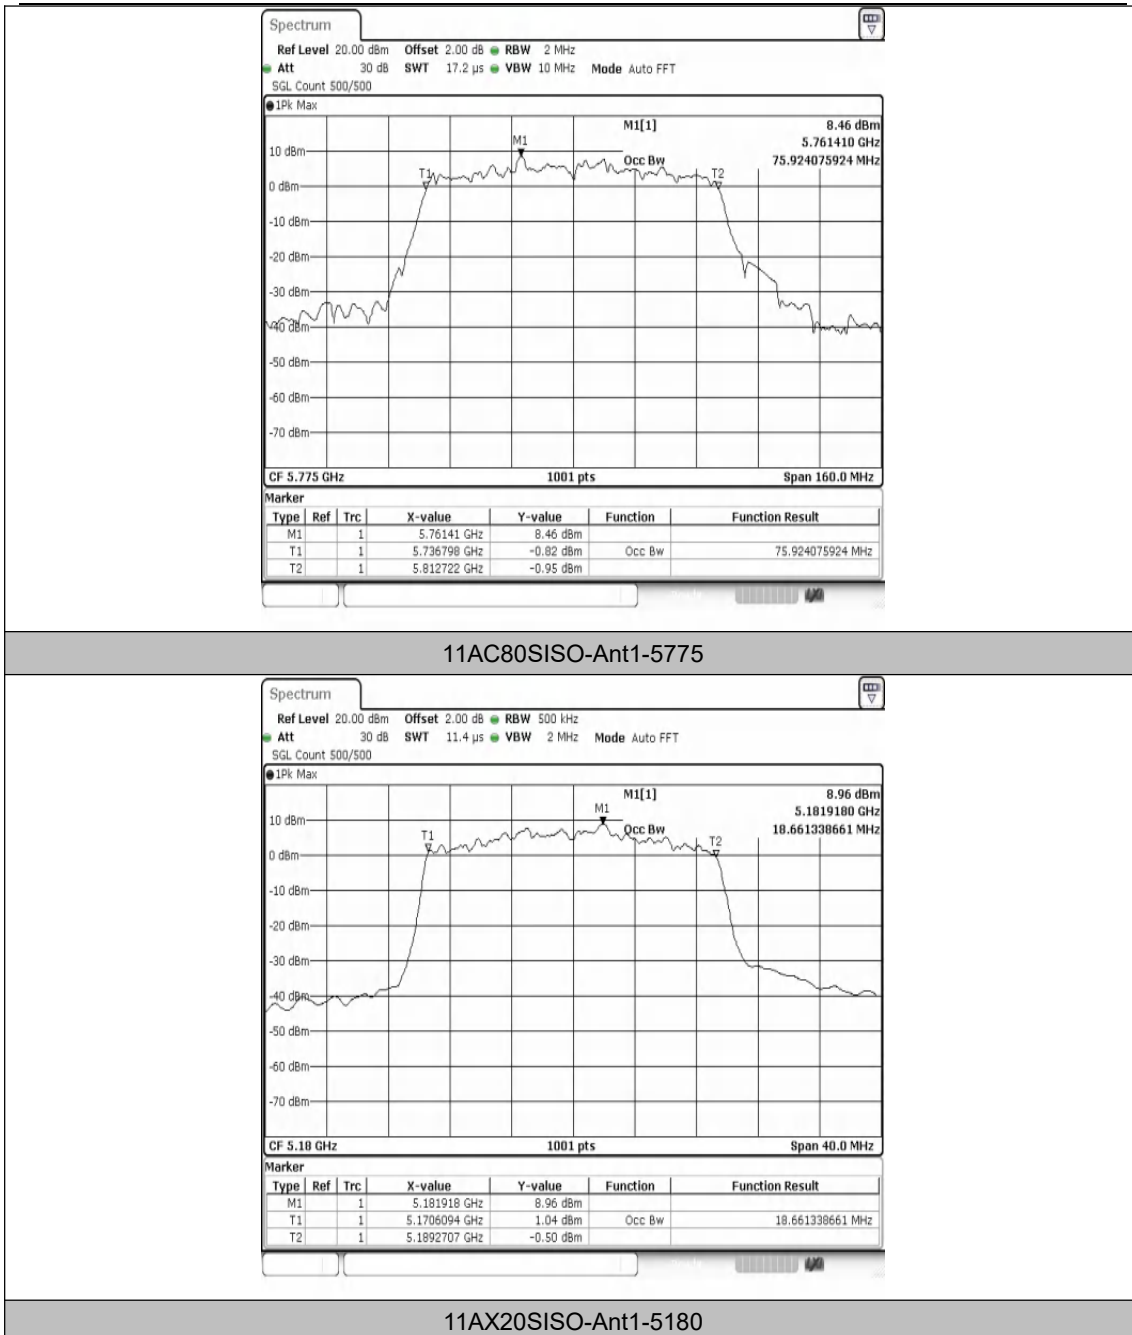

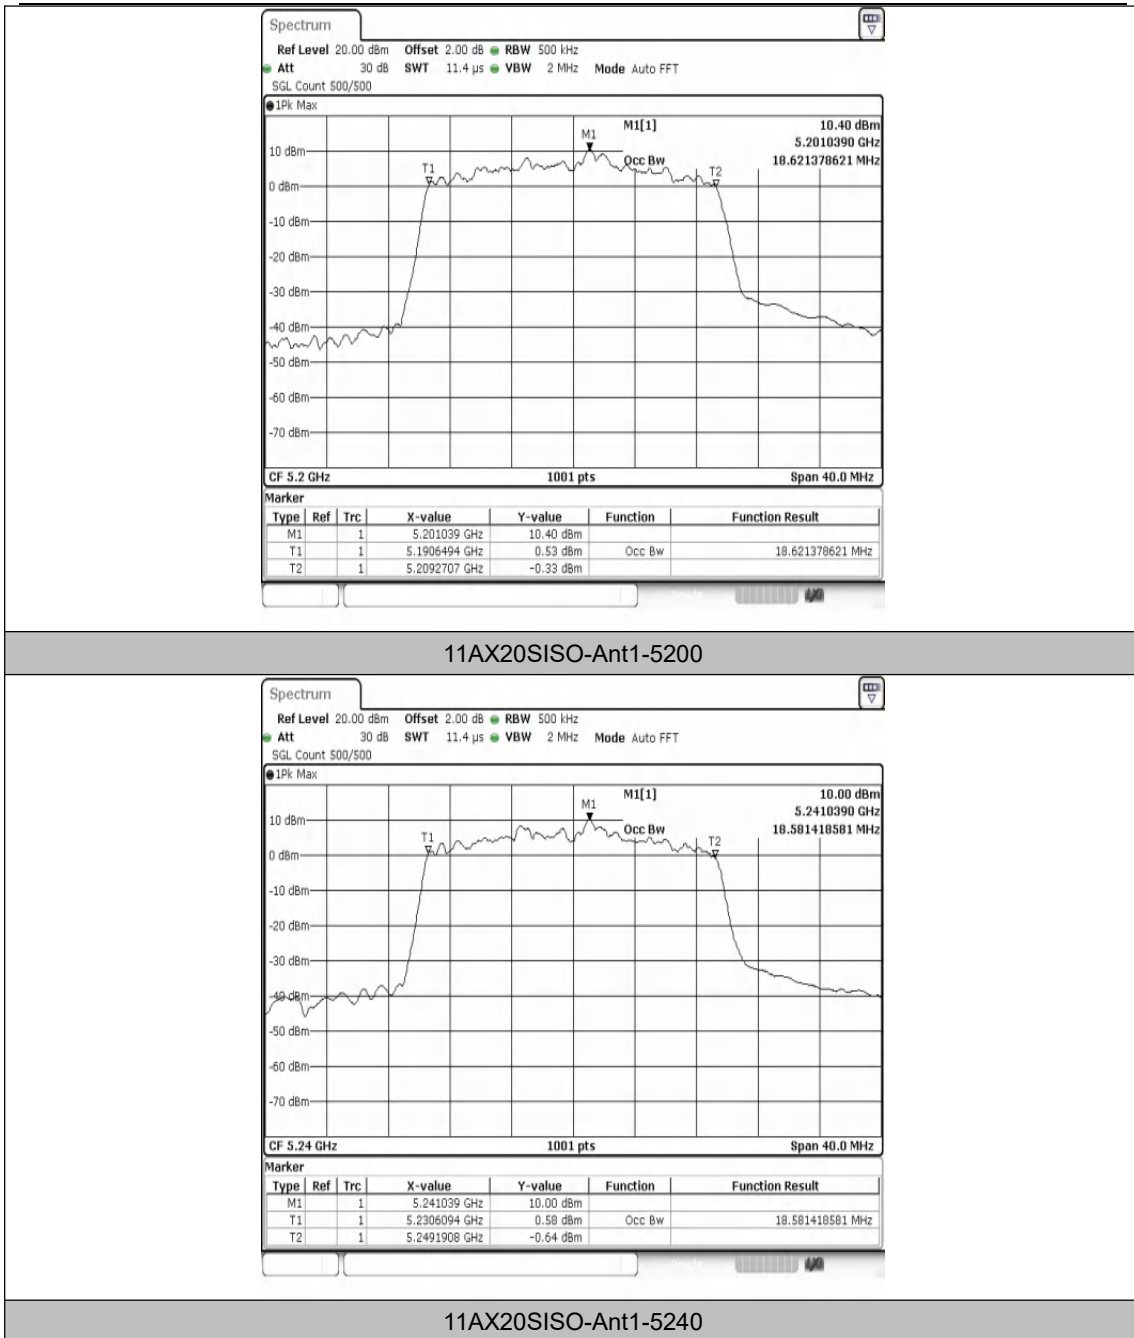



#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



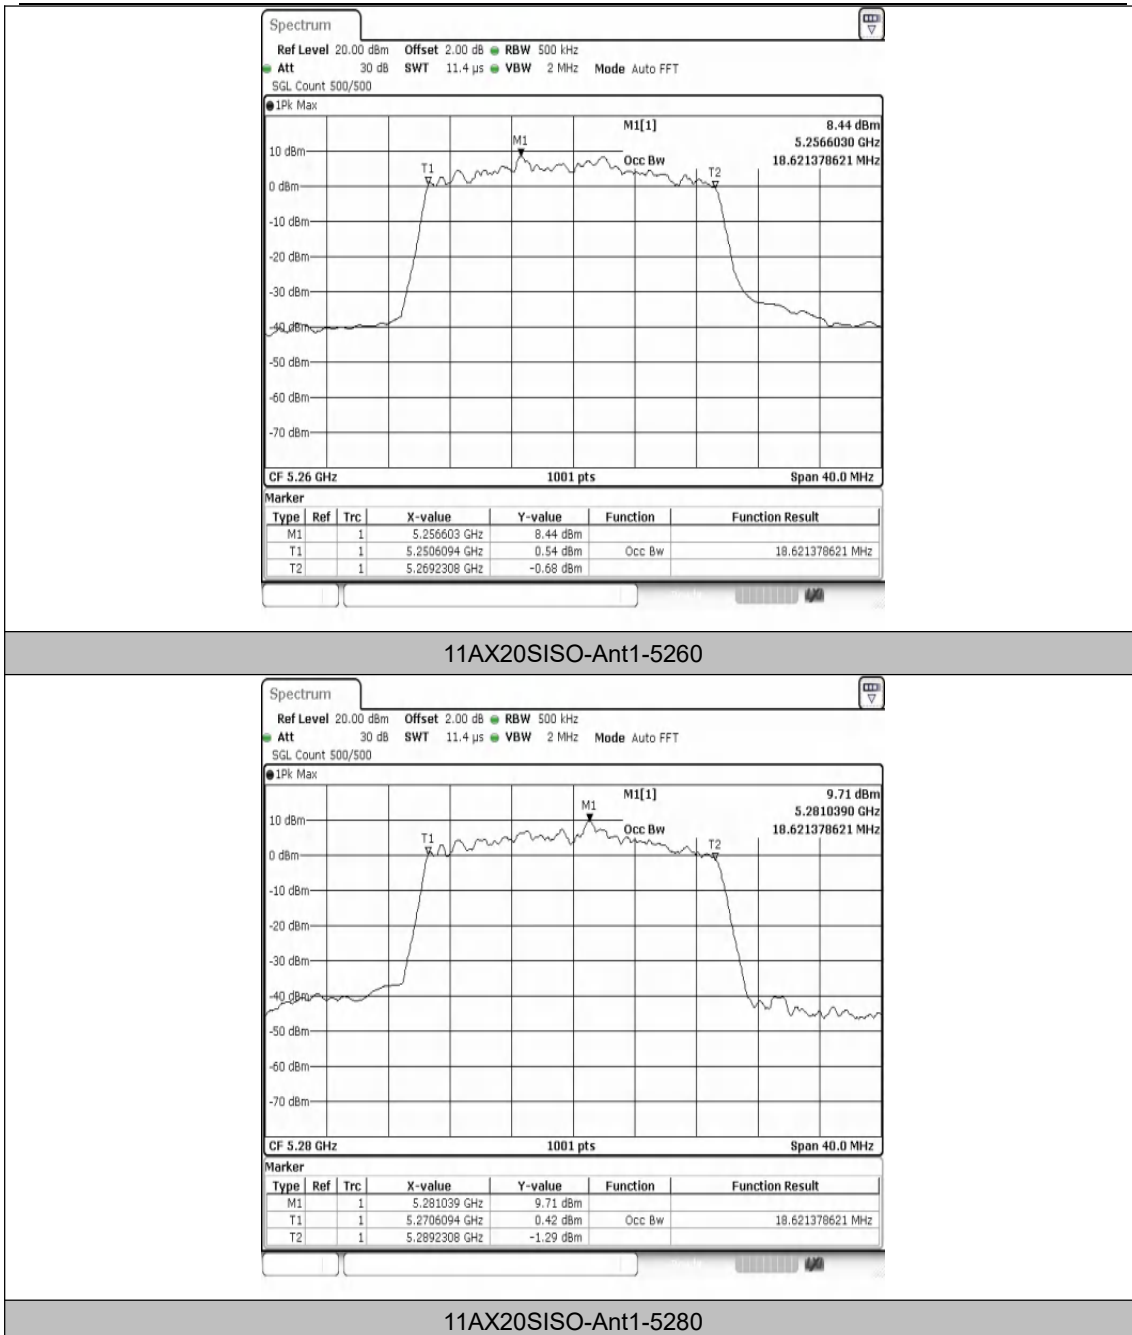


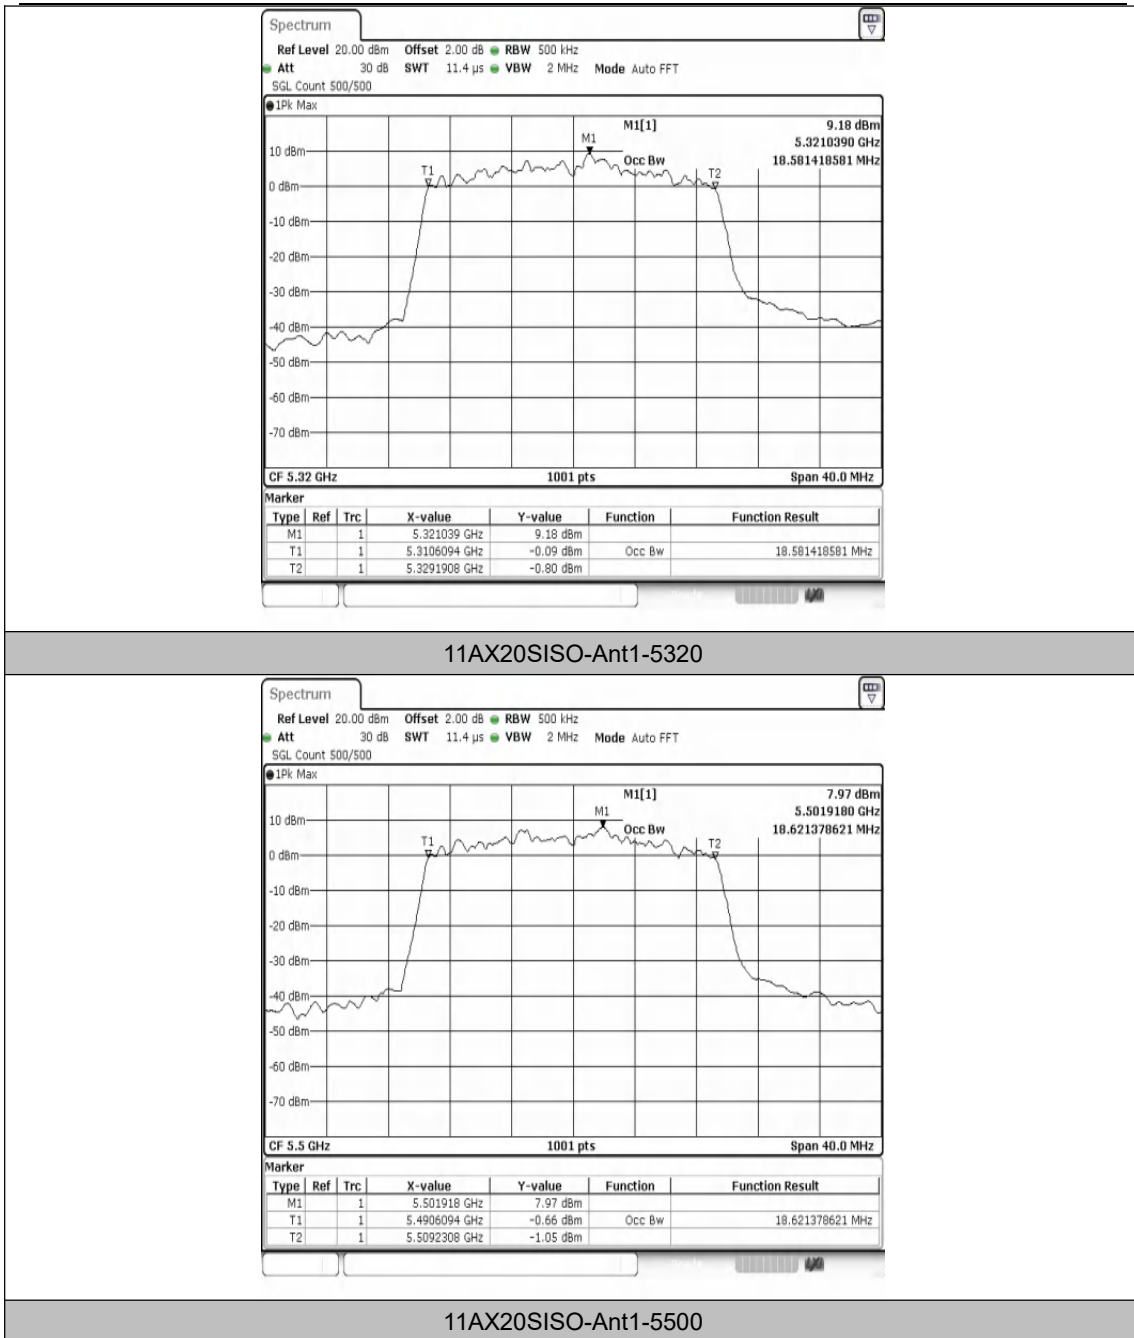


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

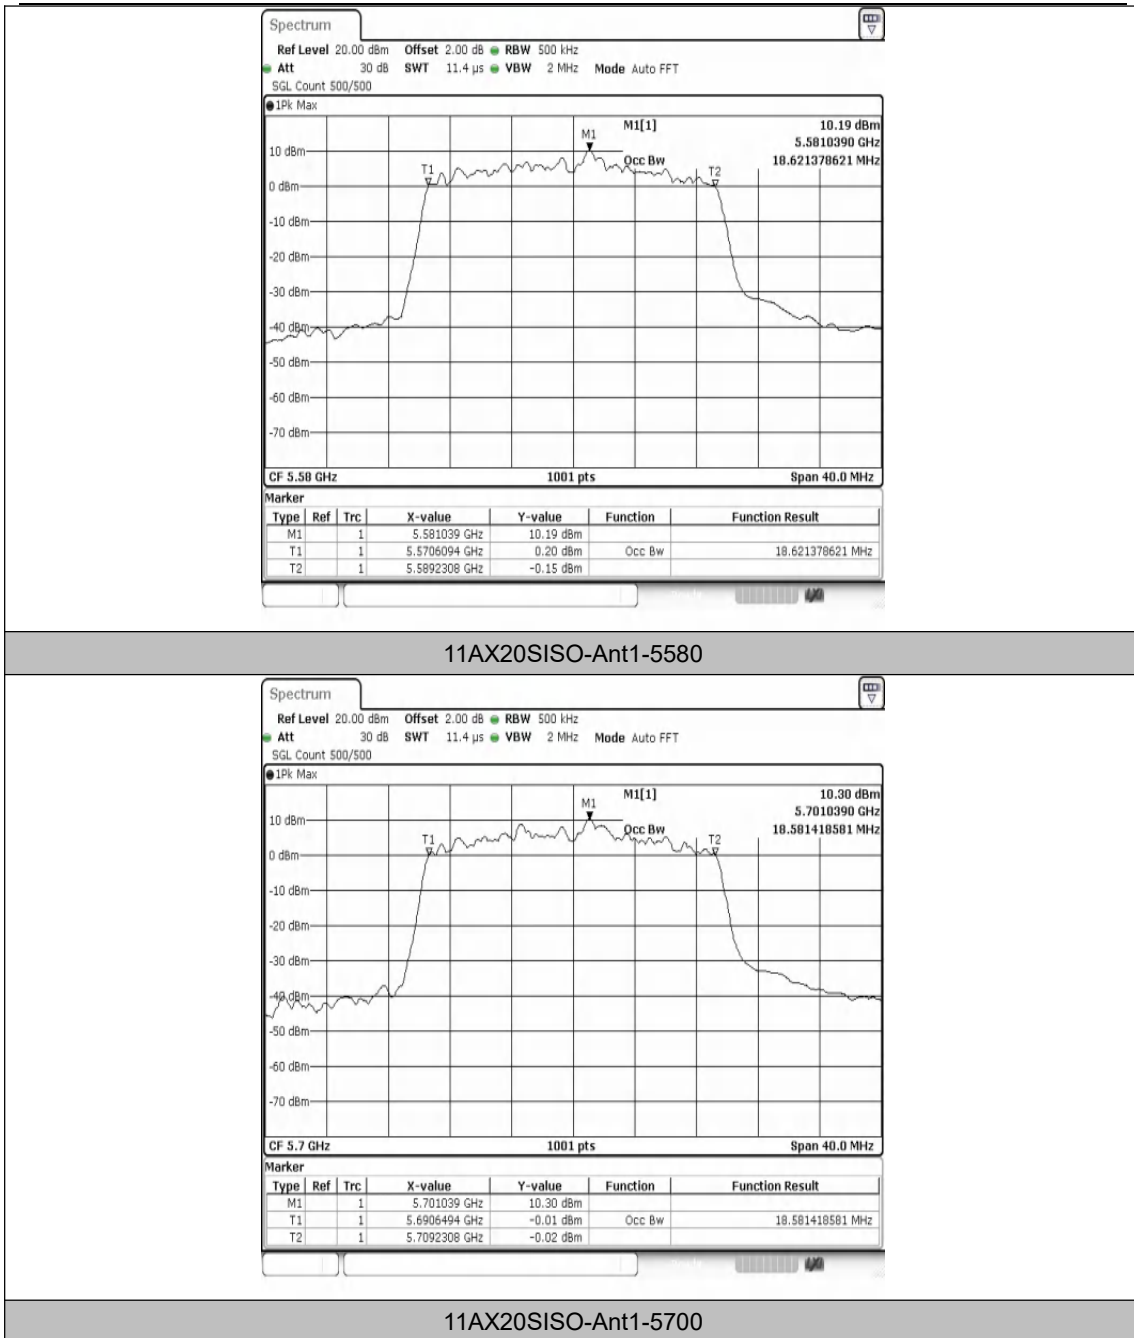


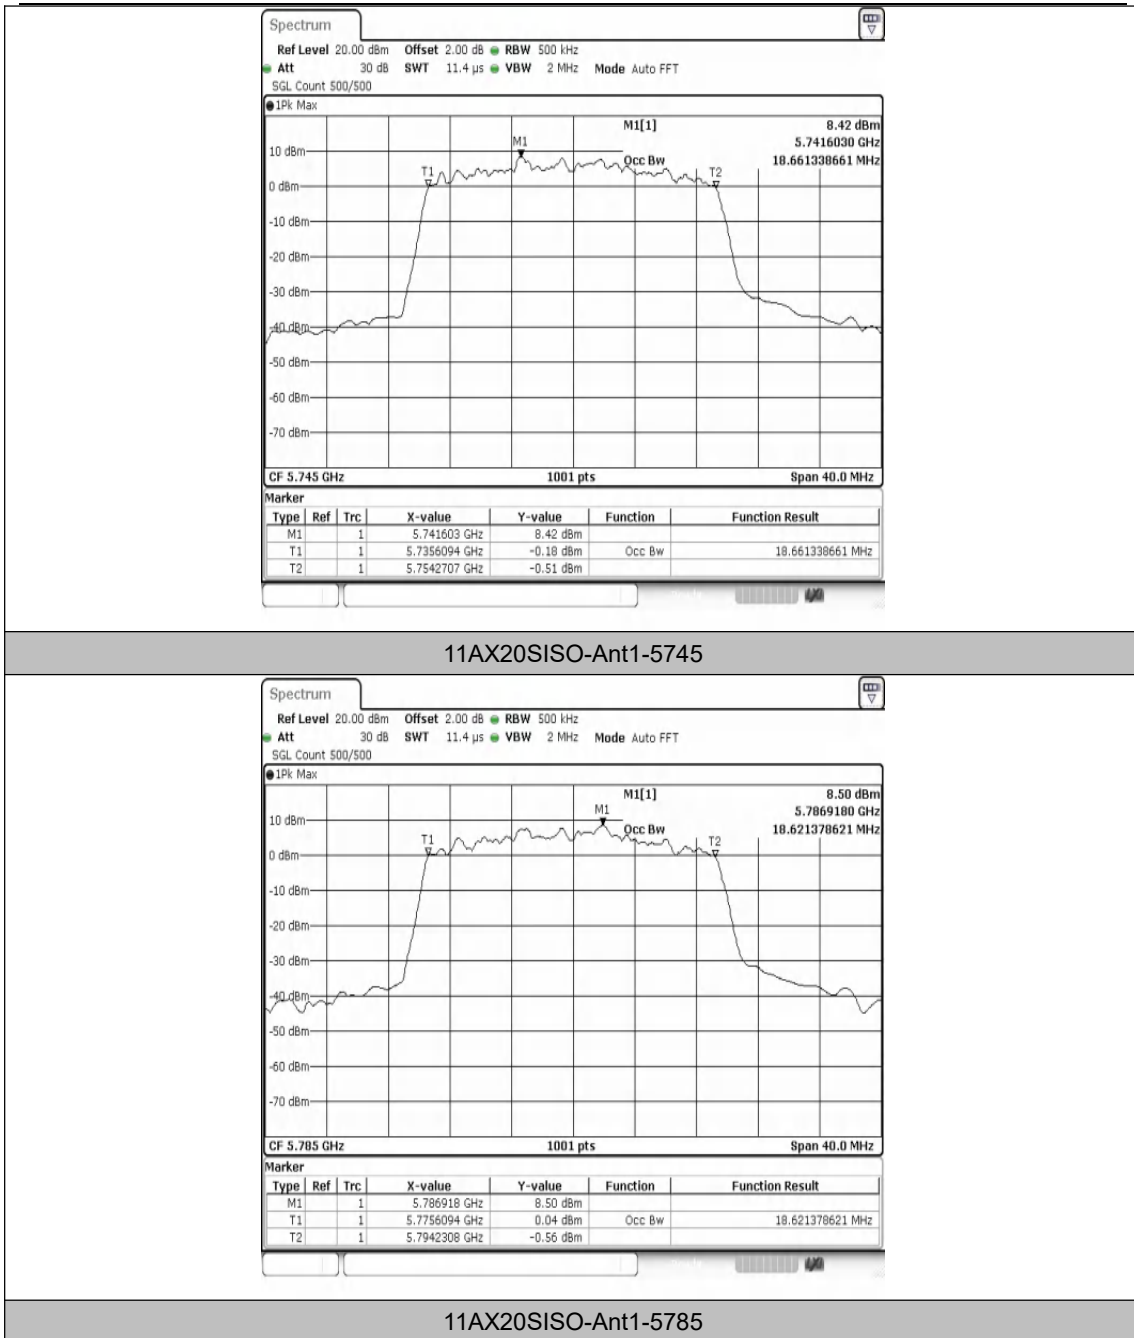


#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

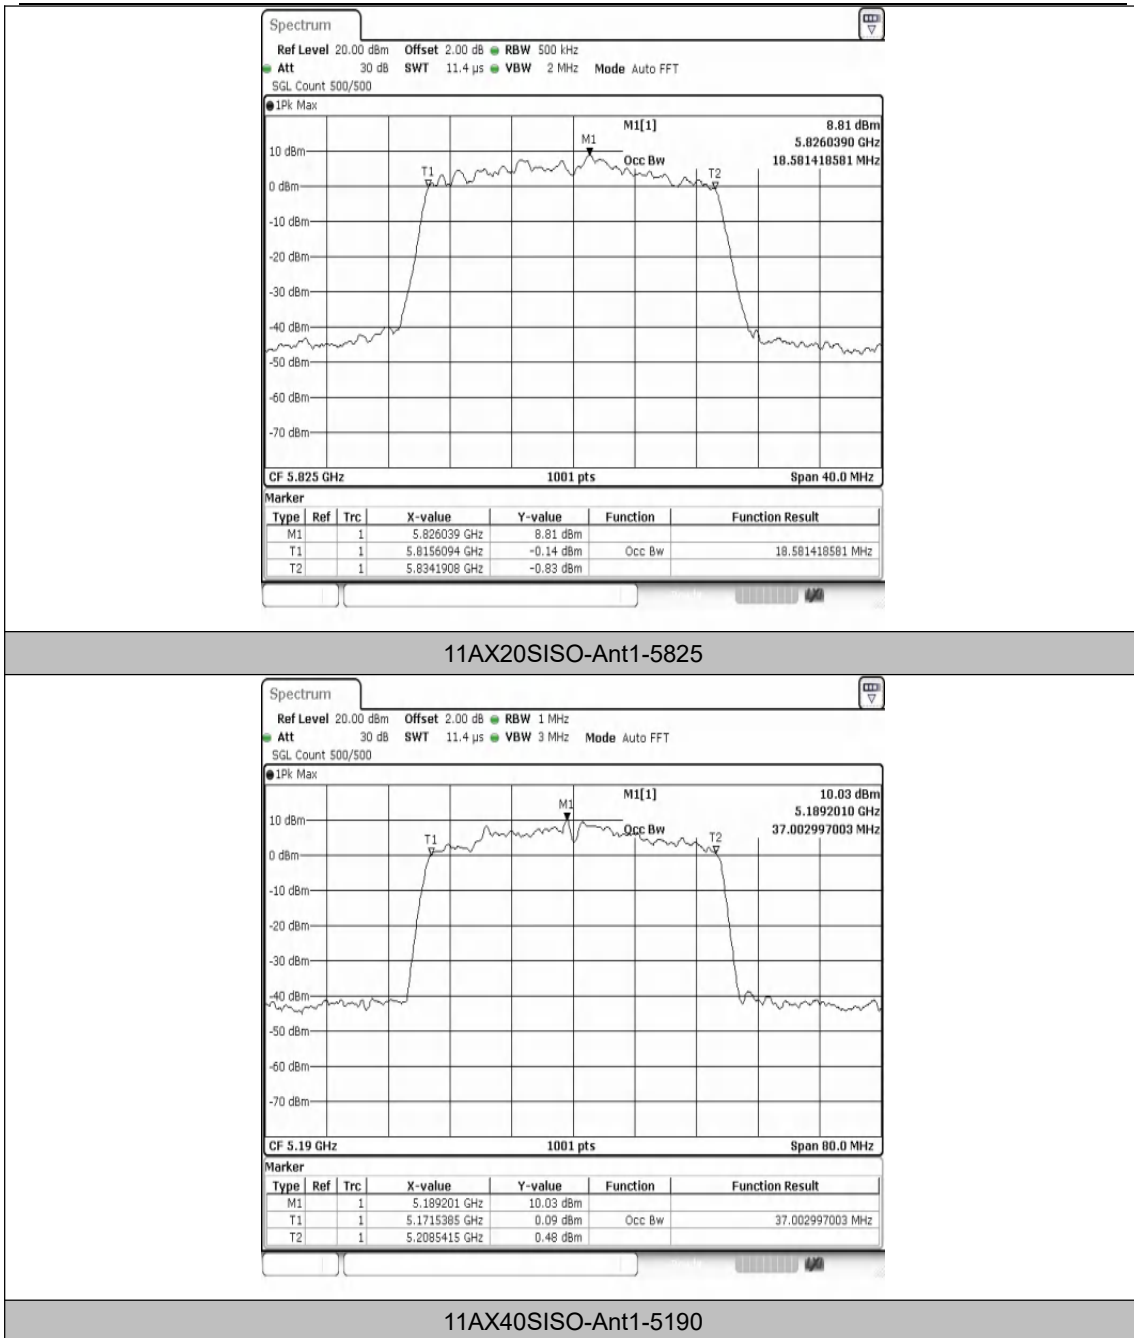

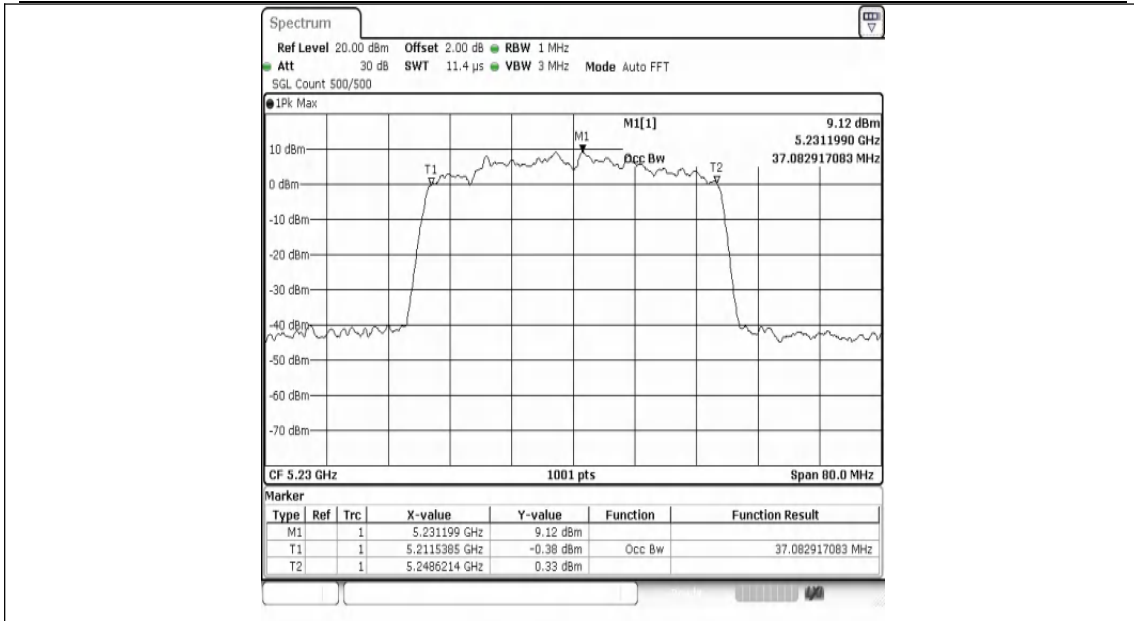


11AX40SISO-Ant1-5230

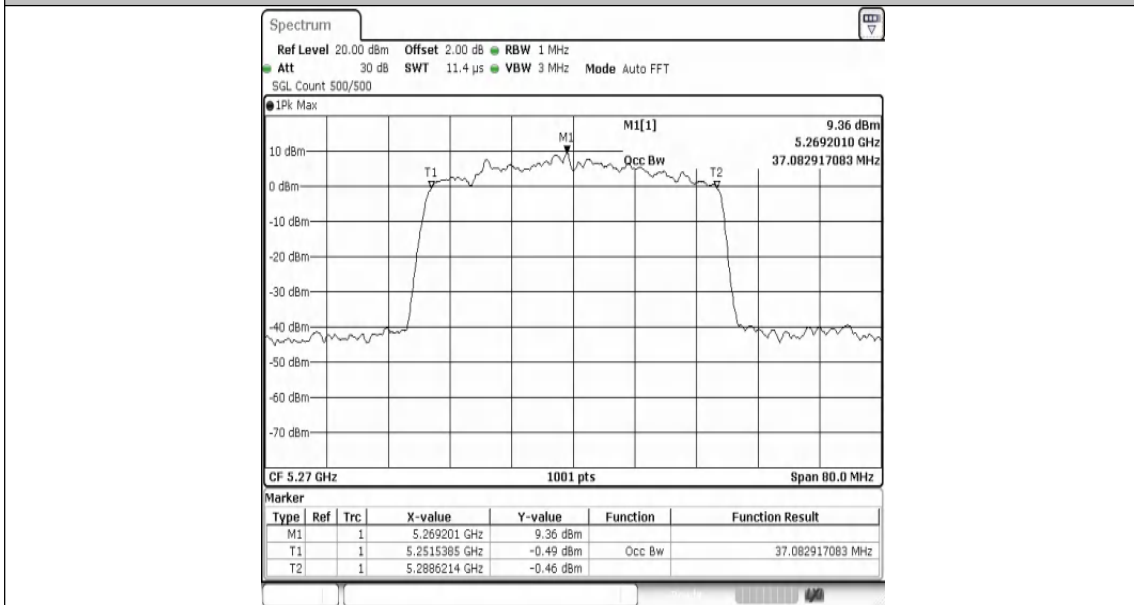

11AX40SISO-Ant1-5270




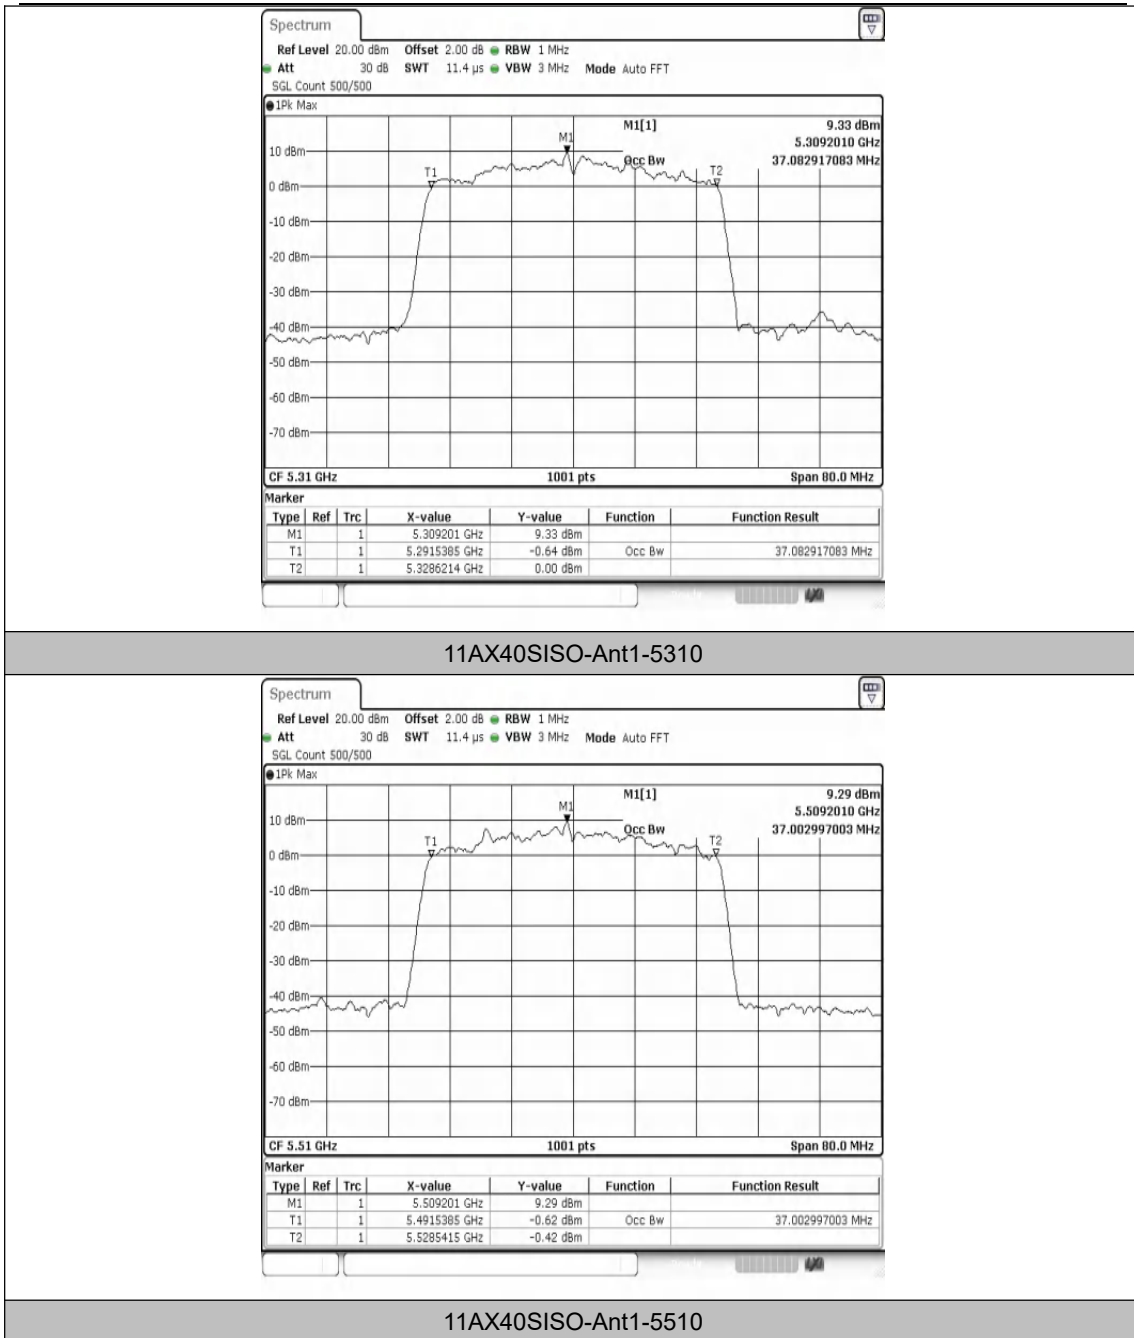


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

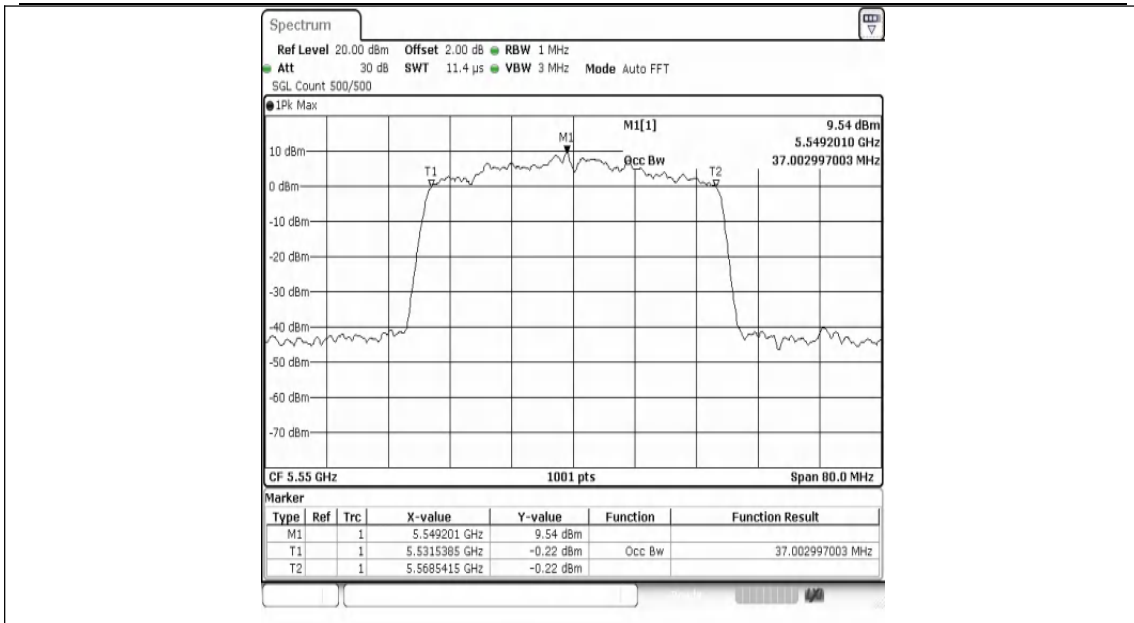


11AX40SISO-Ant1-5550

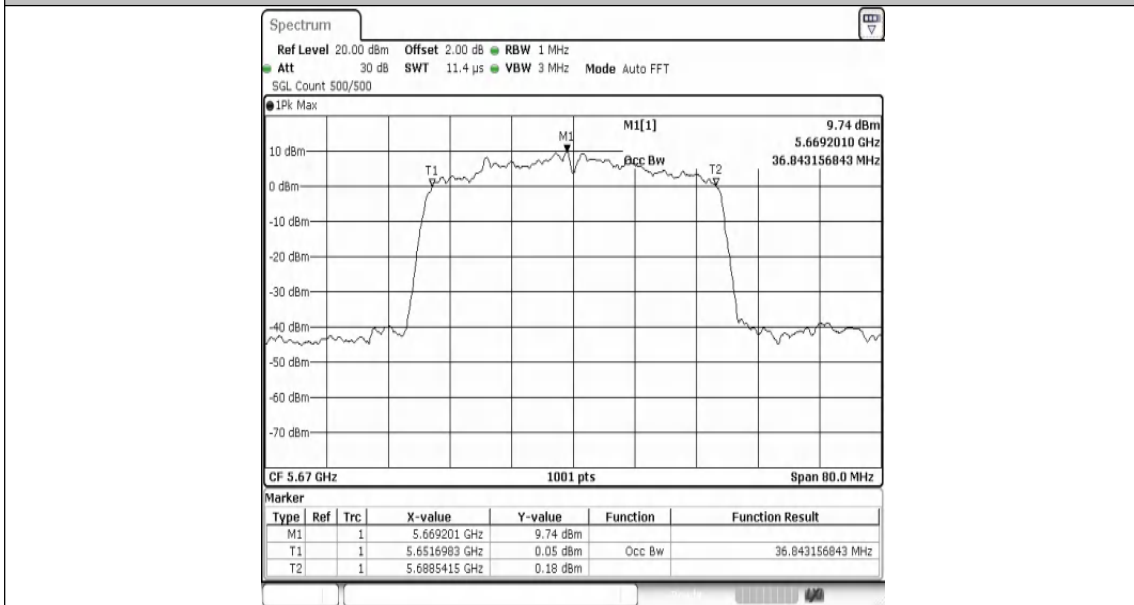


11AX40SISO-Ant1-5670

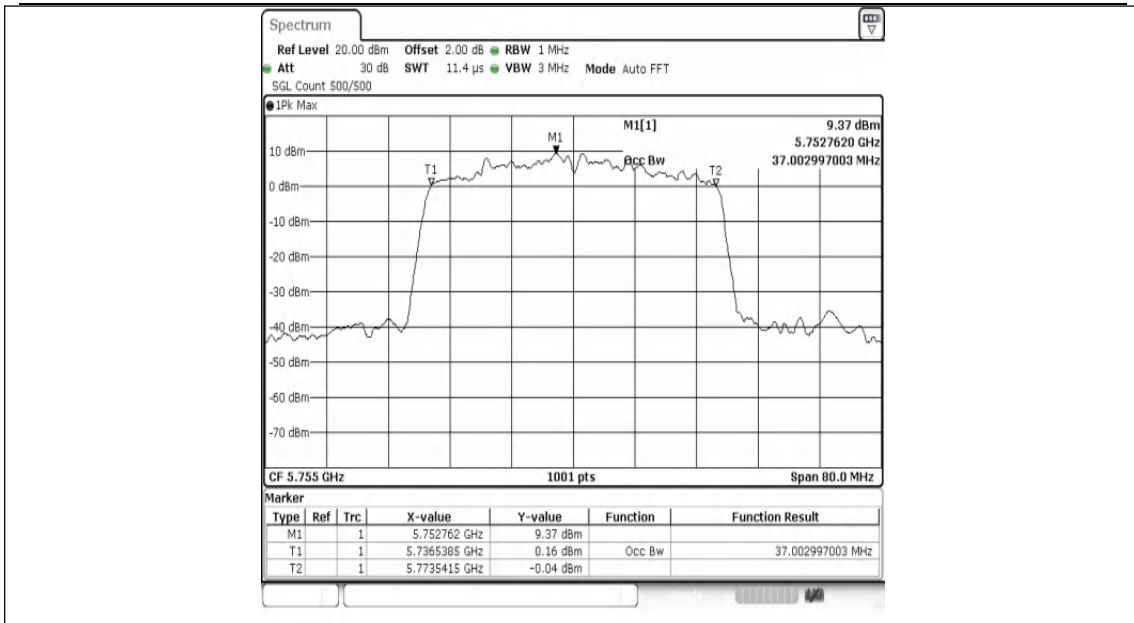

11AX40SISO-Ant1-5755

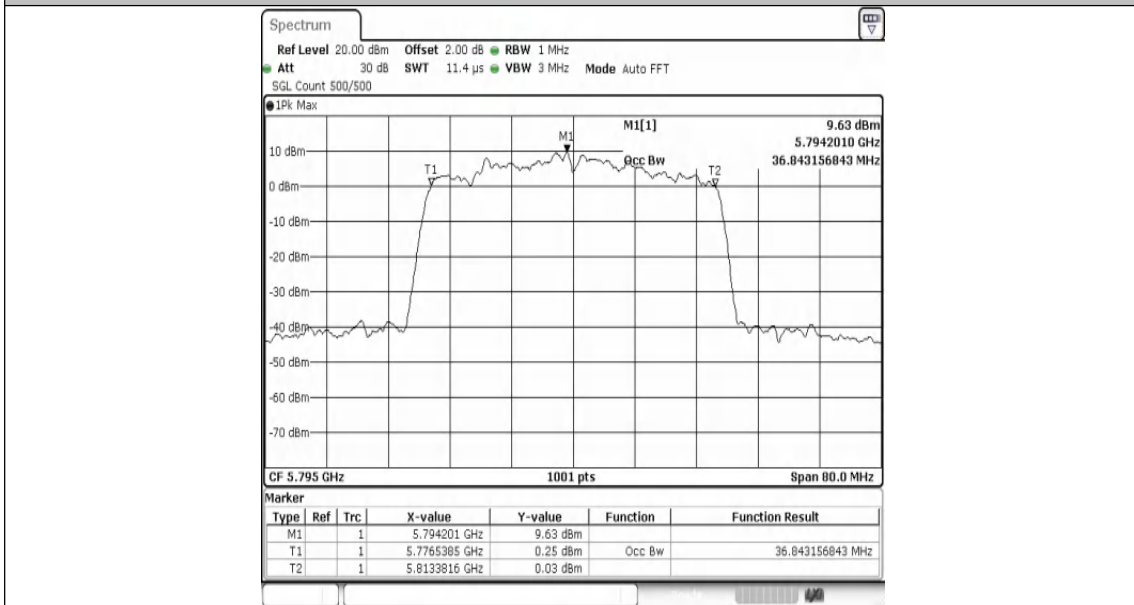


11AX40SISO-Ant1-5795

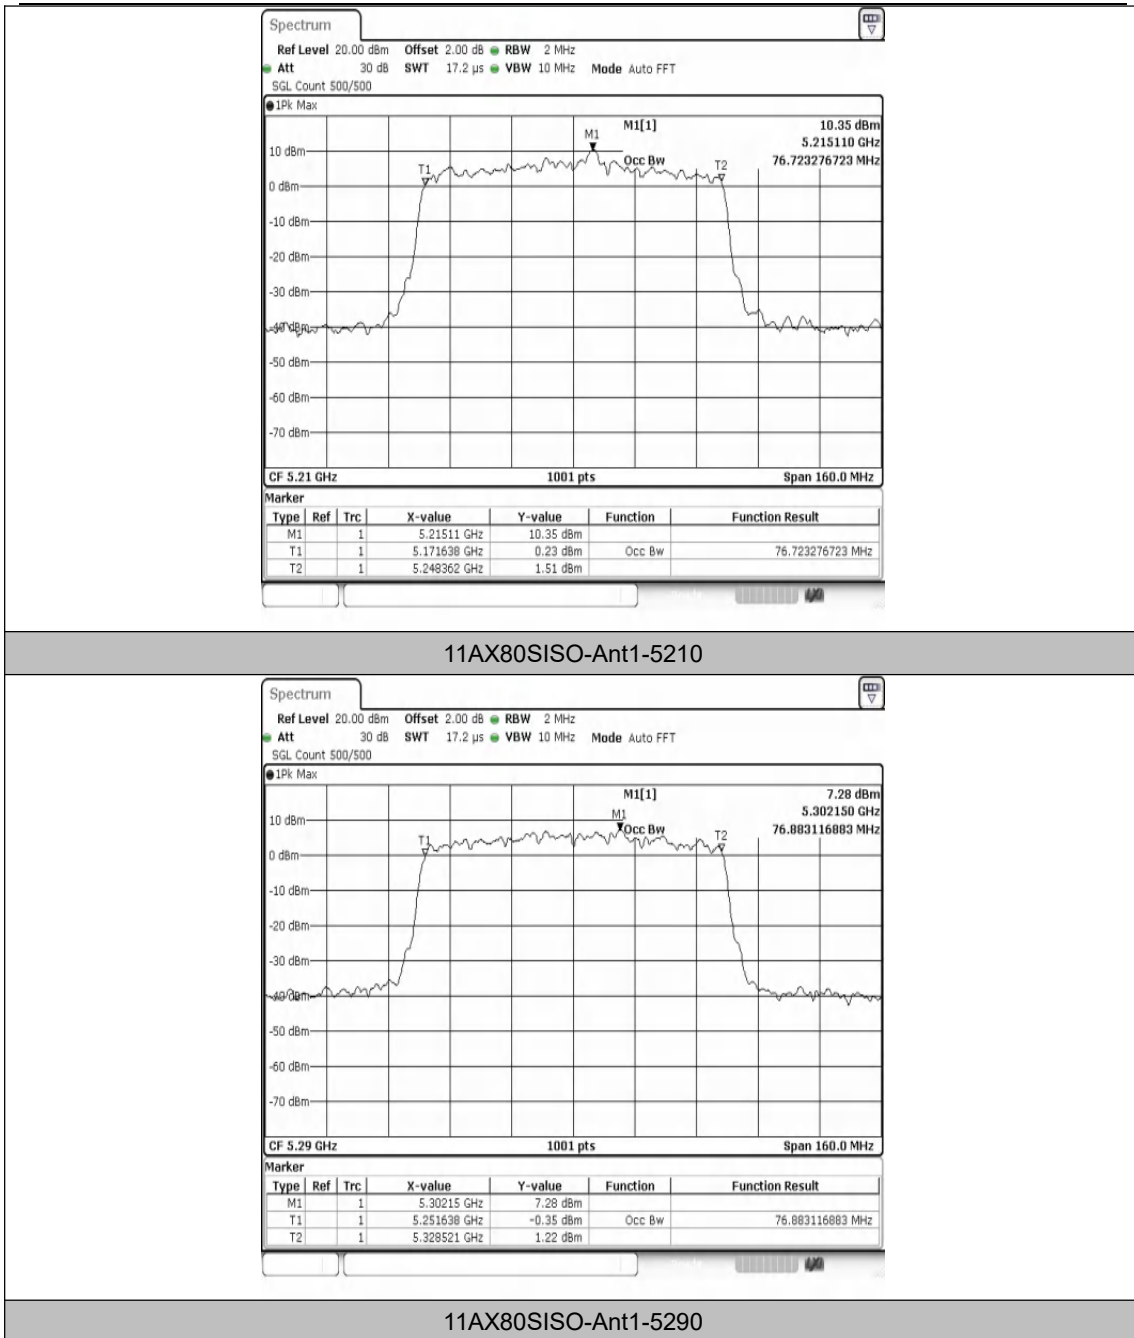

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

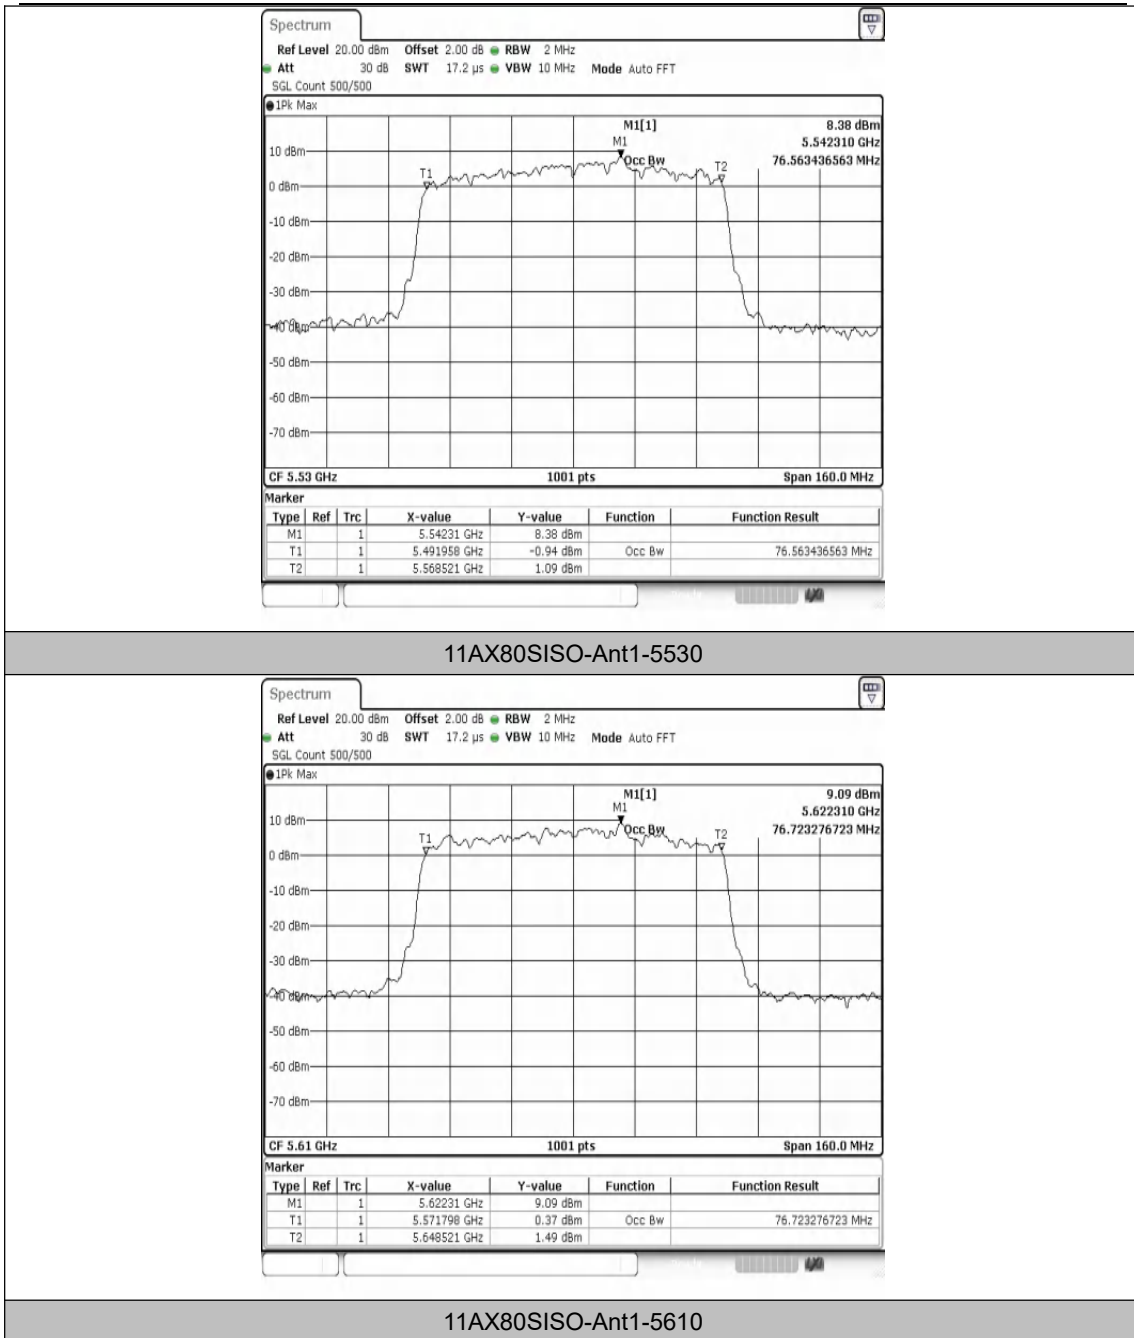



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



## Appendix A3: Minimum 6dB Bandwidth

### Test Result B4

Test Mode	Antenna	Frequency [MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.56	5736.72	5753.28	0.5	PASS
11A	Ant1	5785	16.36	5776.80	5793.16	0.5	PASS
11A	Ant1	5825	16.36	5816.80	5833.16	0.5	PASS
11N20SISO	Ant1	5745	17.76	5736.12	5753.88	0.5	PASS
11N20SISO	Ant1	5785	17.60	5776.20	5793.80	0.5	PASS
11N20SISO	Ant1	5825	17.76	5816.12	5833.88	0.5	PASS
11N40SISO	Ant1	5755	36.32	5736.84	5773.16	0.5	PASS
11N40SISO	Ant1	5795	36.32	5776.84	5813.16	0.5	PASS
11AC20SISO	Ant1	5745	17.60	5736.20	5753.80	0.5	PASS
11AC20SISO	Ant1	5785	17.84	5776.08	5793.92	0.5	PASS
11AC20SISO	Ant1	5825	17.80	5816.12	5833.92	0.5	PASS
11AC40SISO	Ant1	5755	36.64	5736.68	5773.32	0.5	PASS
11AC40SISO	Ant1	5795	36.48	5776.76	5813.24	0.5	PASS
11AC80SISO	Ant1	5775	76.48	5736.76	5813.24	0.5	PASS
11AX20SISO	Ant1	5745	18.96	5735.52	5754.48	0.5	PASS
11AX20SISO	Ant1	5785	18.96	5775.52	5794.48	0.5	PASS
11AX20SISO	Ant1	5825	19.08	5815.48	5834.56	0.5	PASS
11AX40SISO	Ant1	5755	37.76	5736.12	5773.88	0.5	PASS
11AX40SISO	Ant1	5795	37.92	5776.12	5814.04	0.5	PASS
11AX80SISO	Ant1	5775	77.60	5736.12	5813.72	0.5	PASS

## Test Graphs B4

