




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

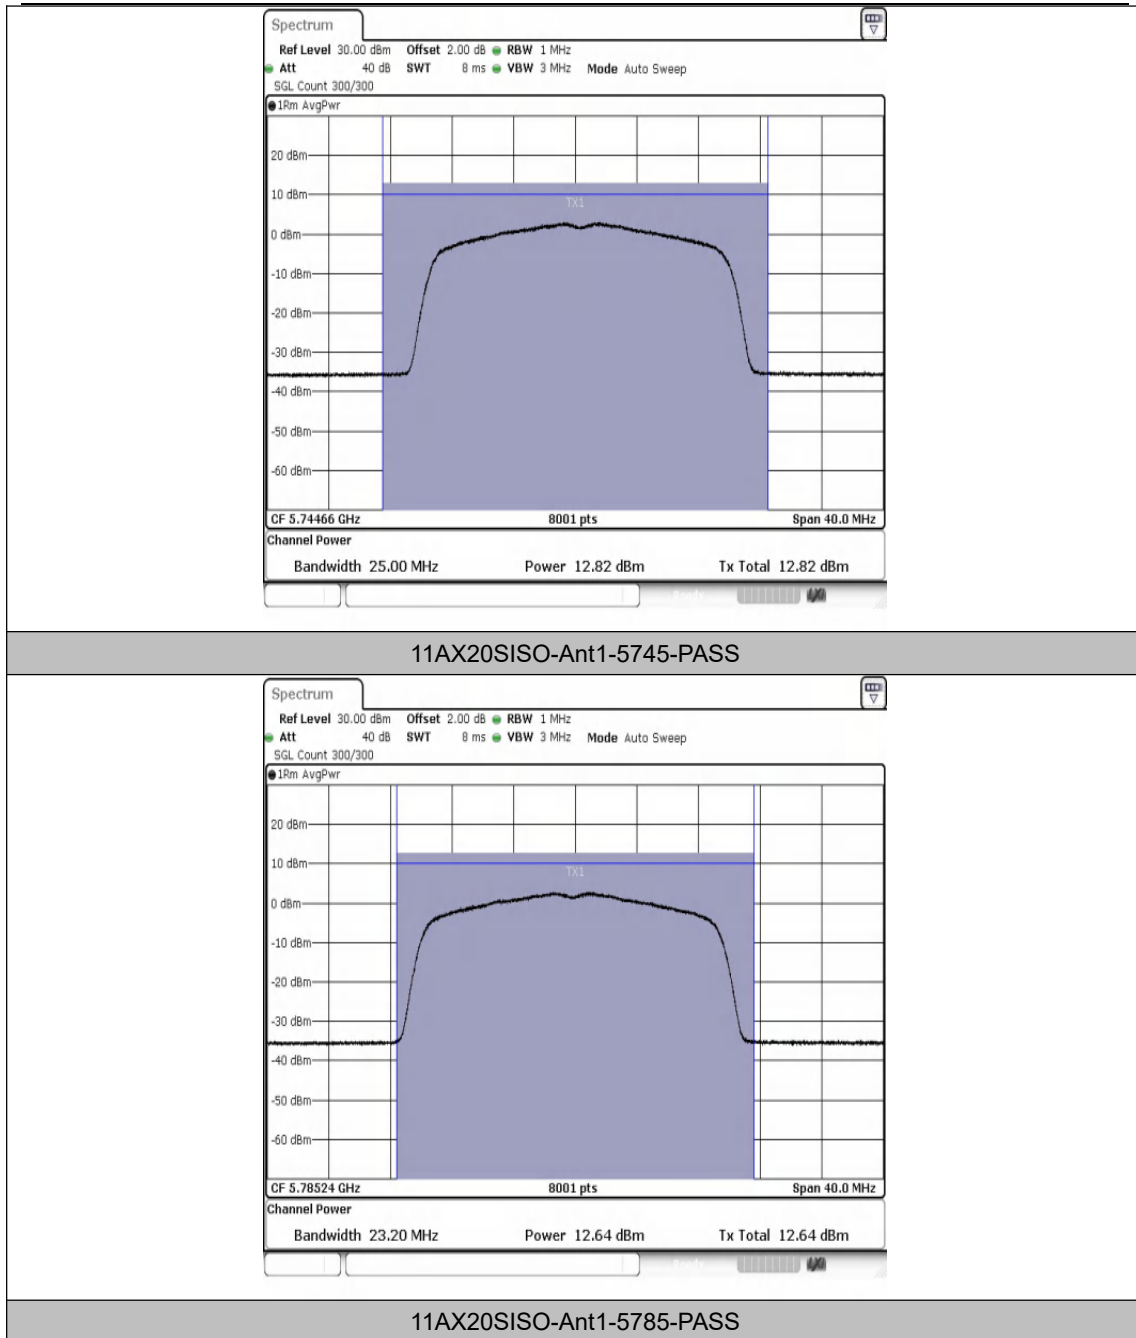

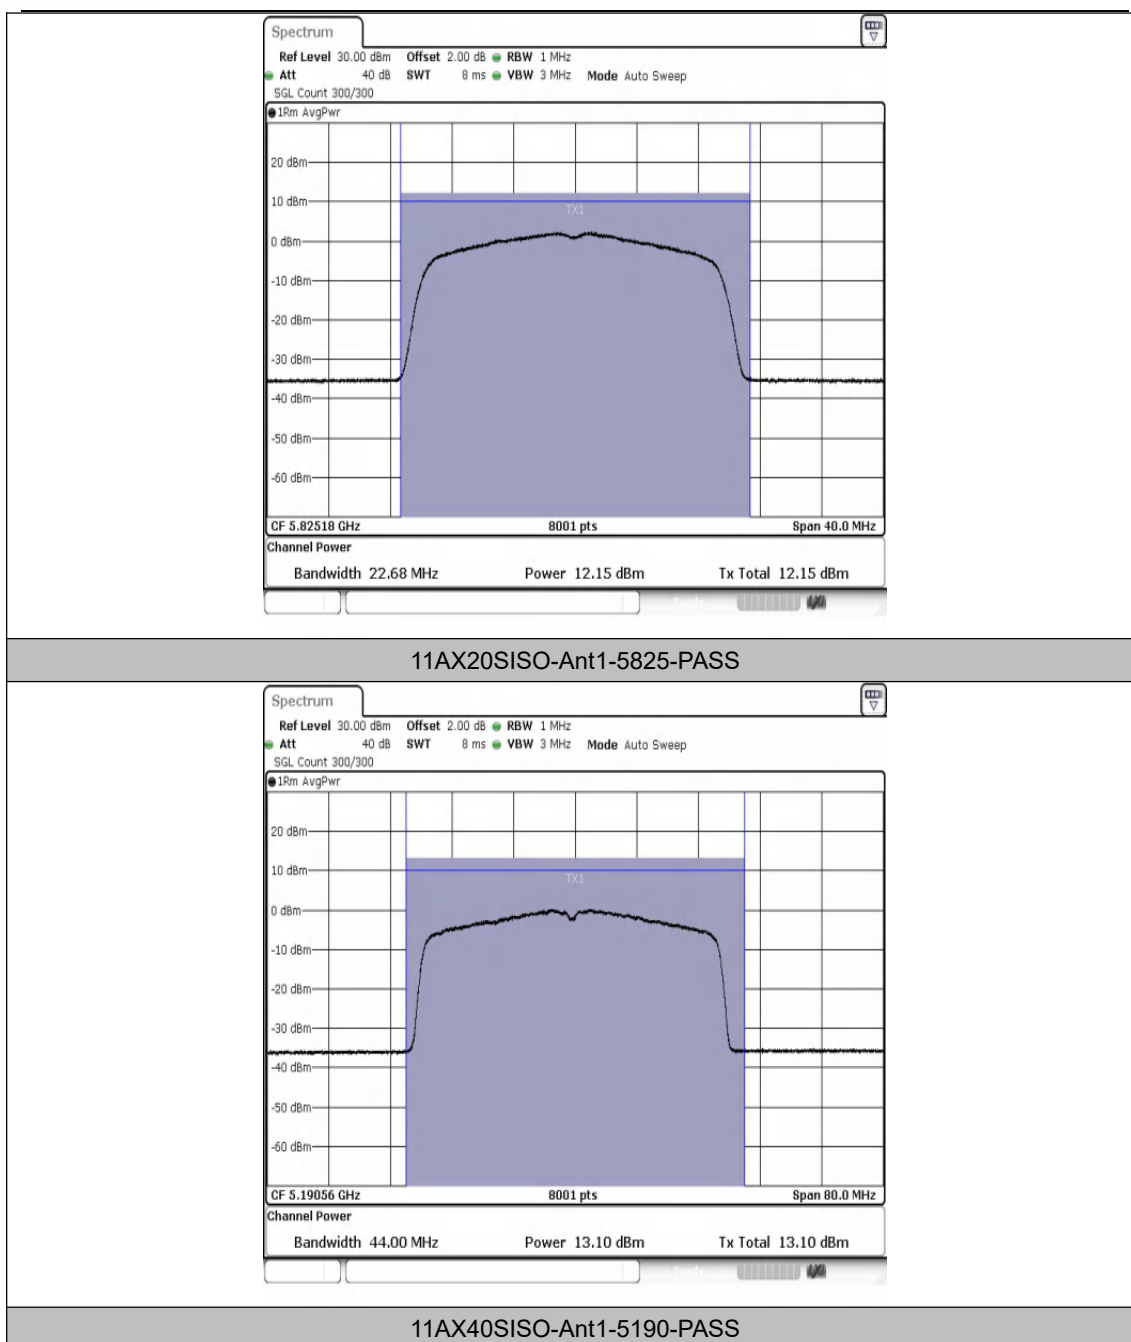


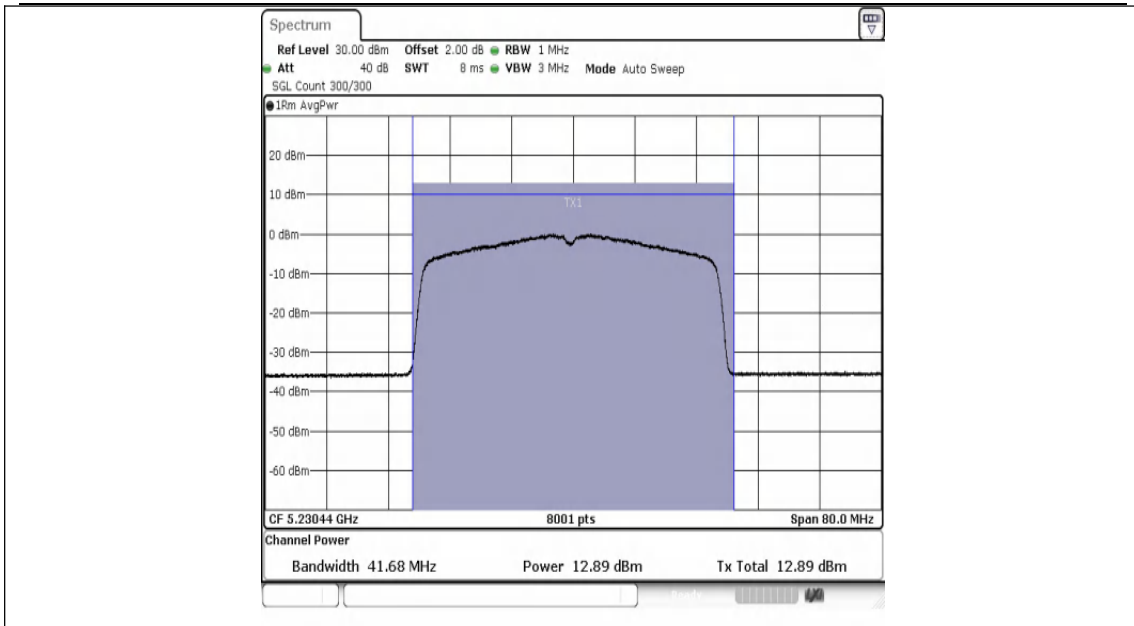


11AX40SISO-Ant1-5230-PASS

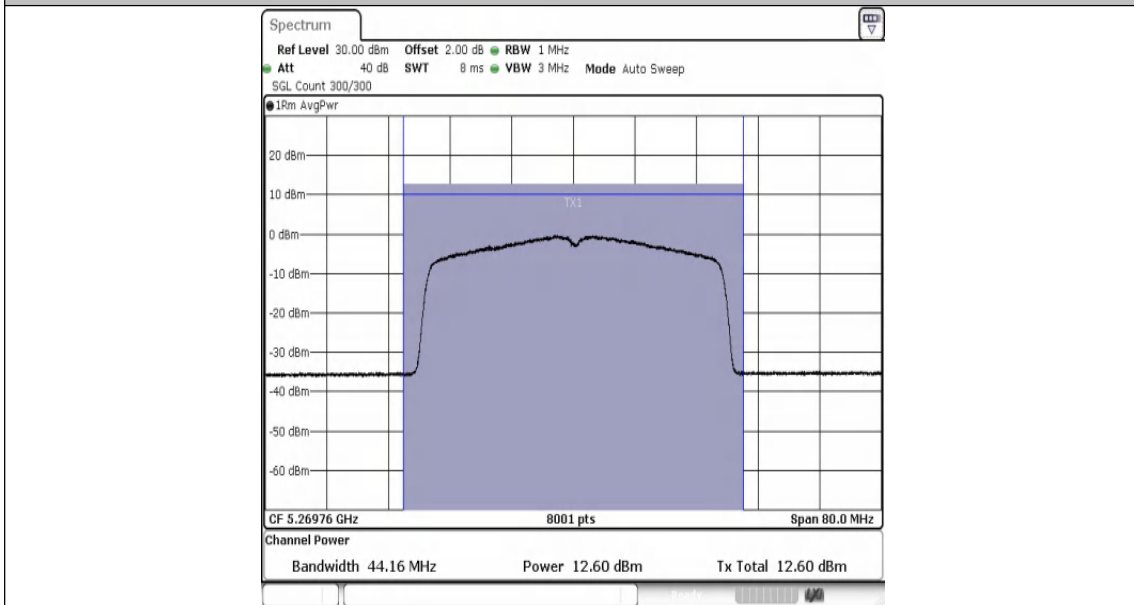

11AX40SISO-Ant1-5270-PASS

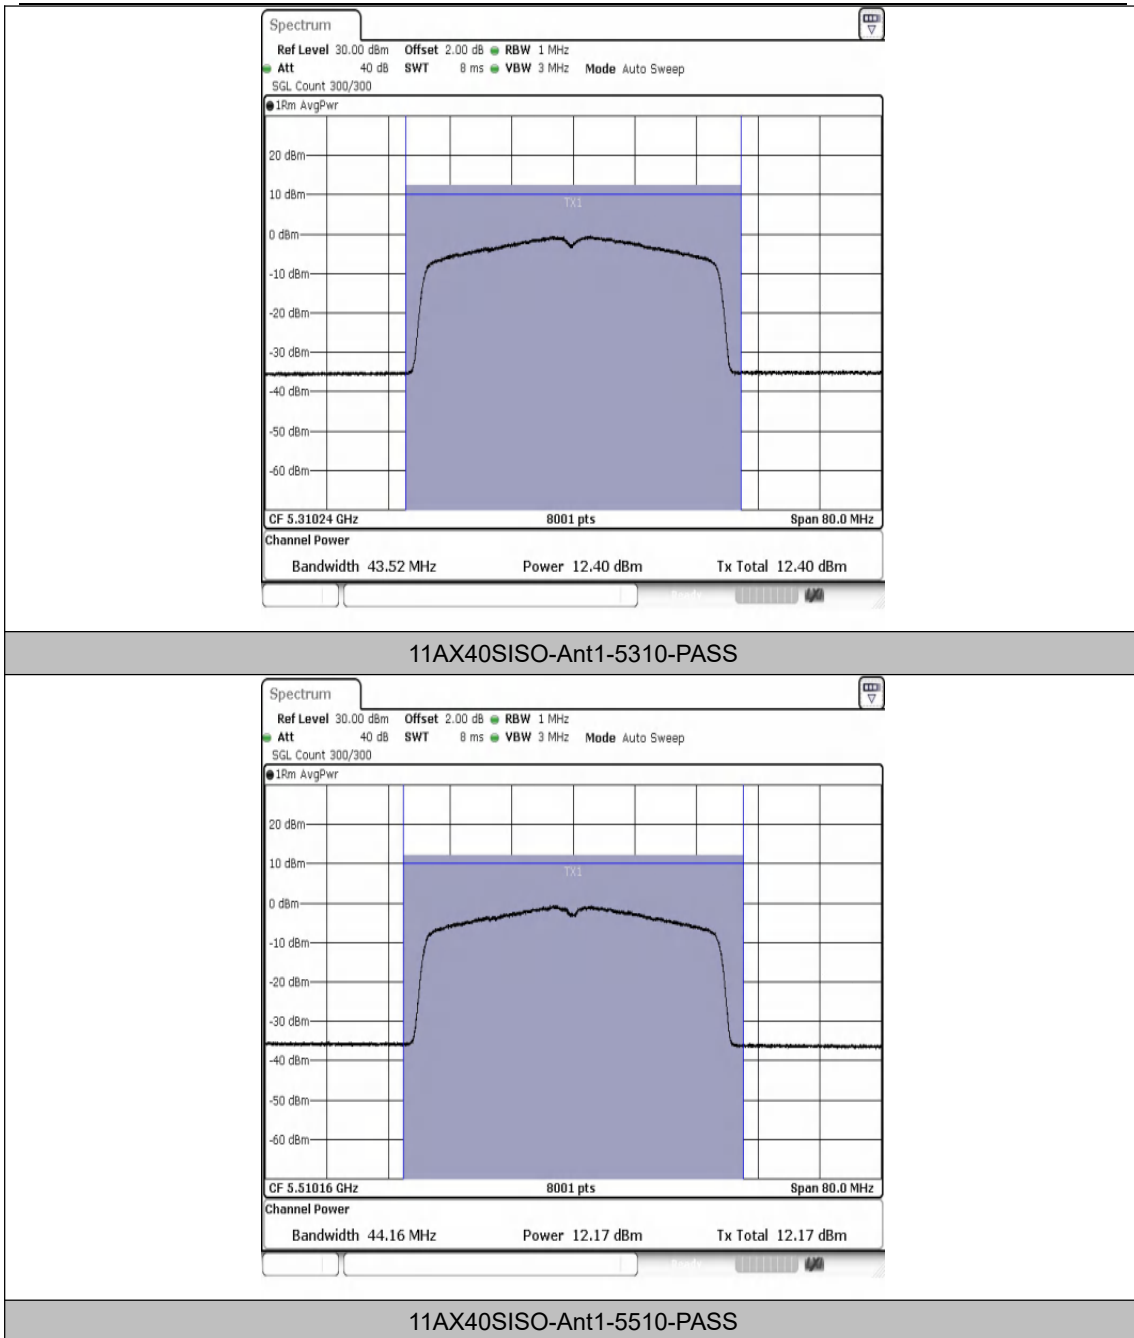


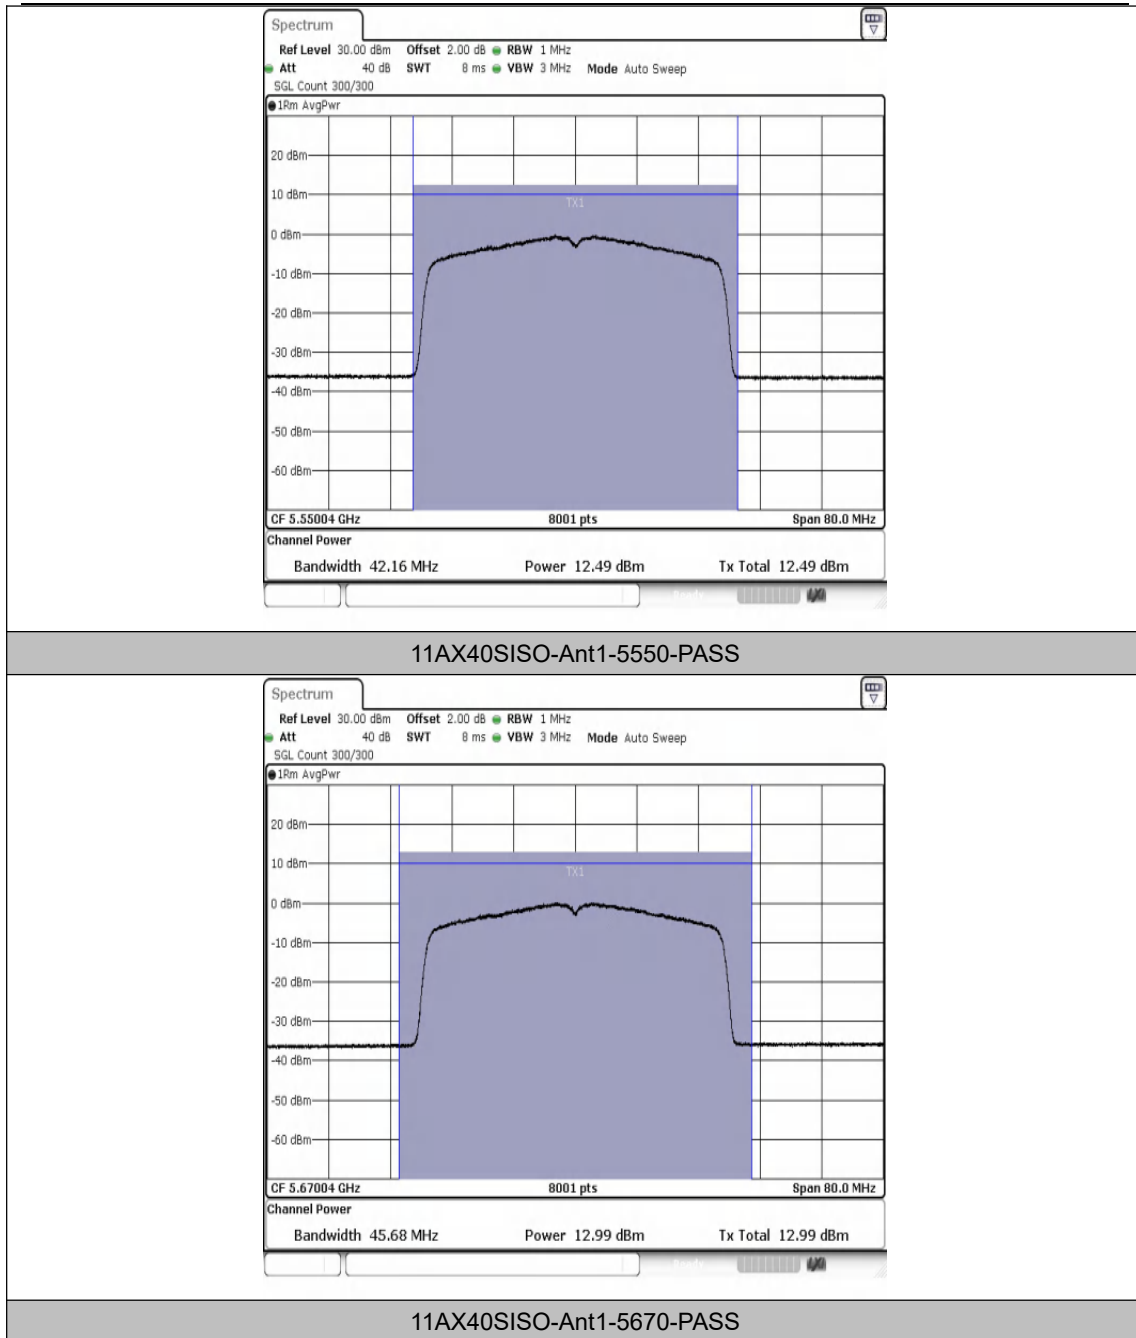



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

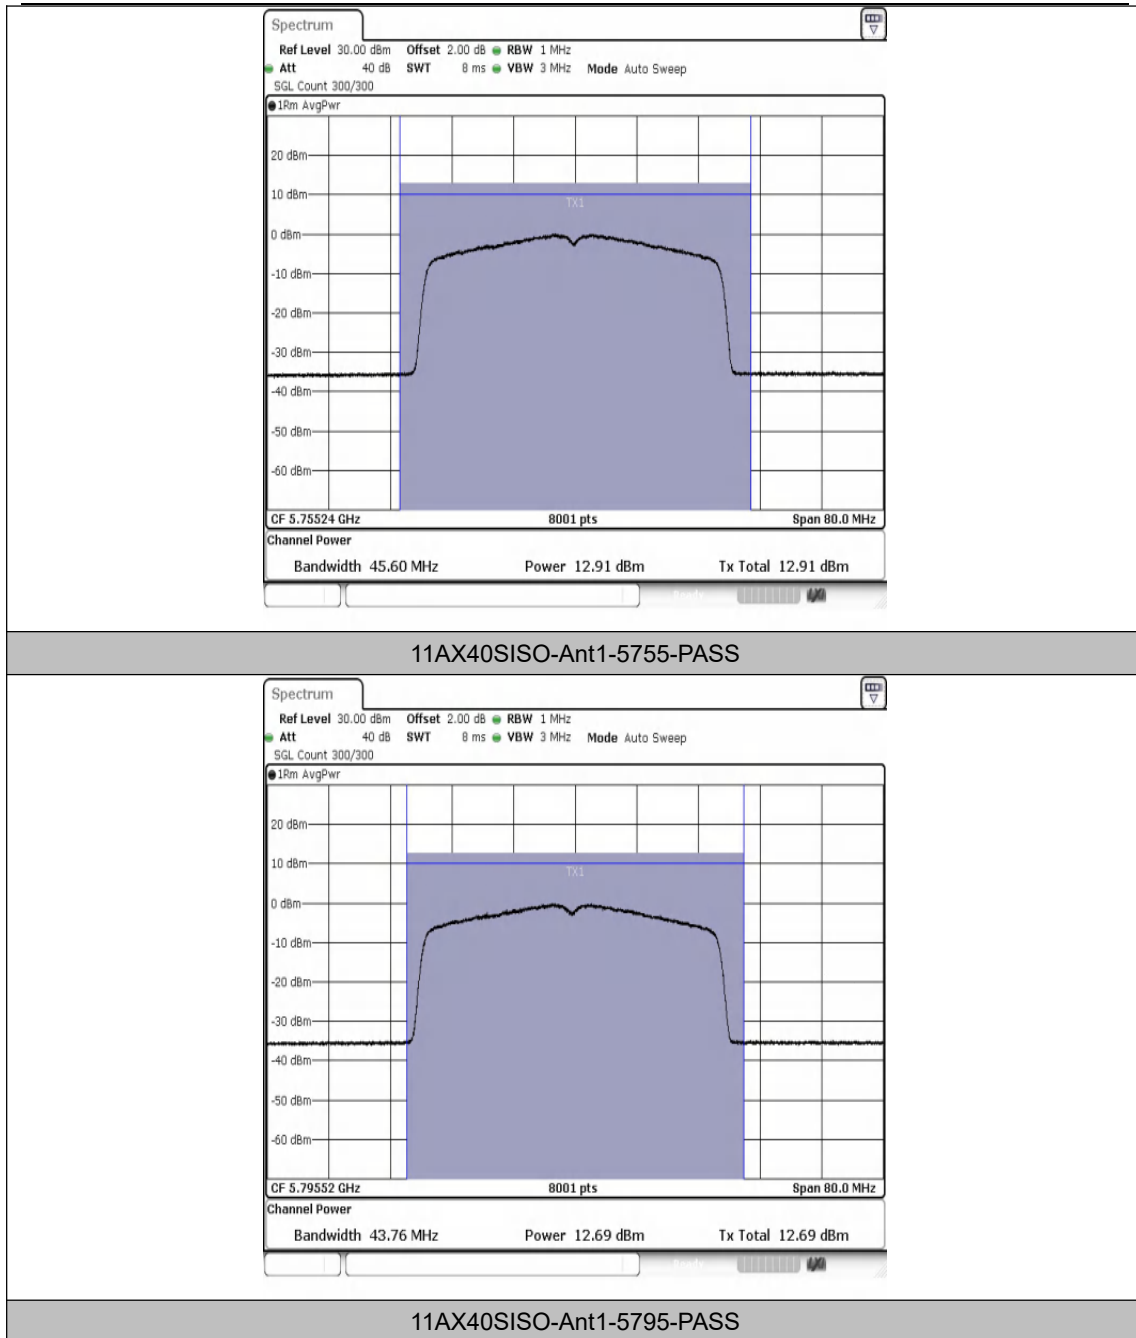

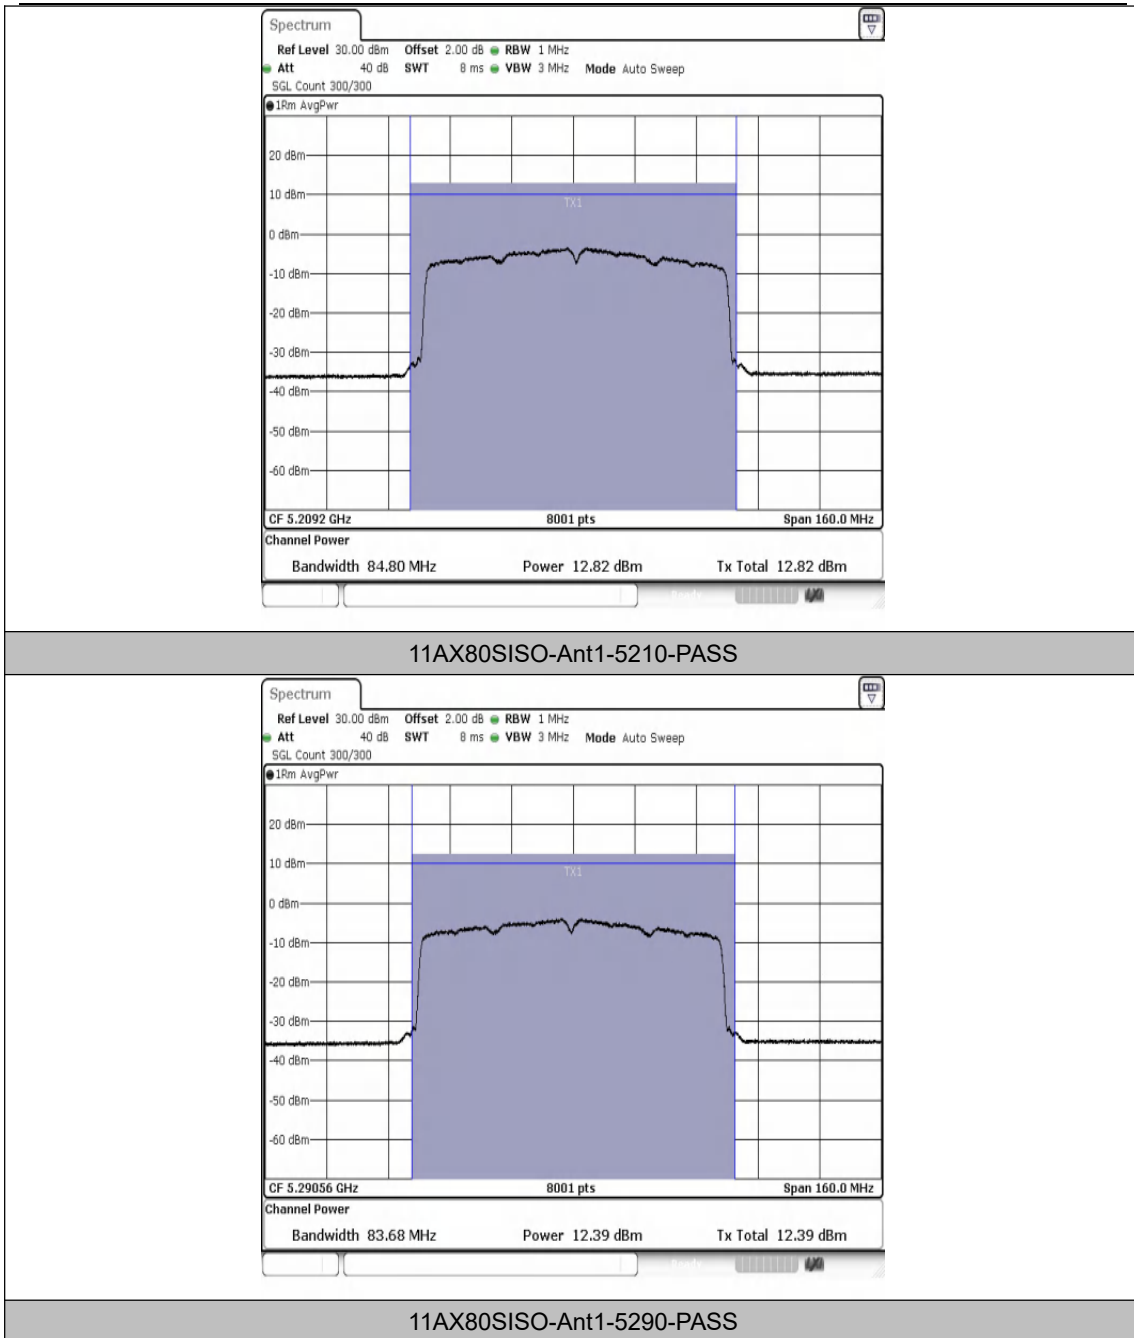


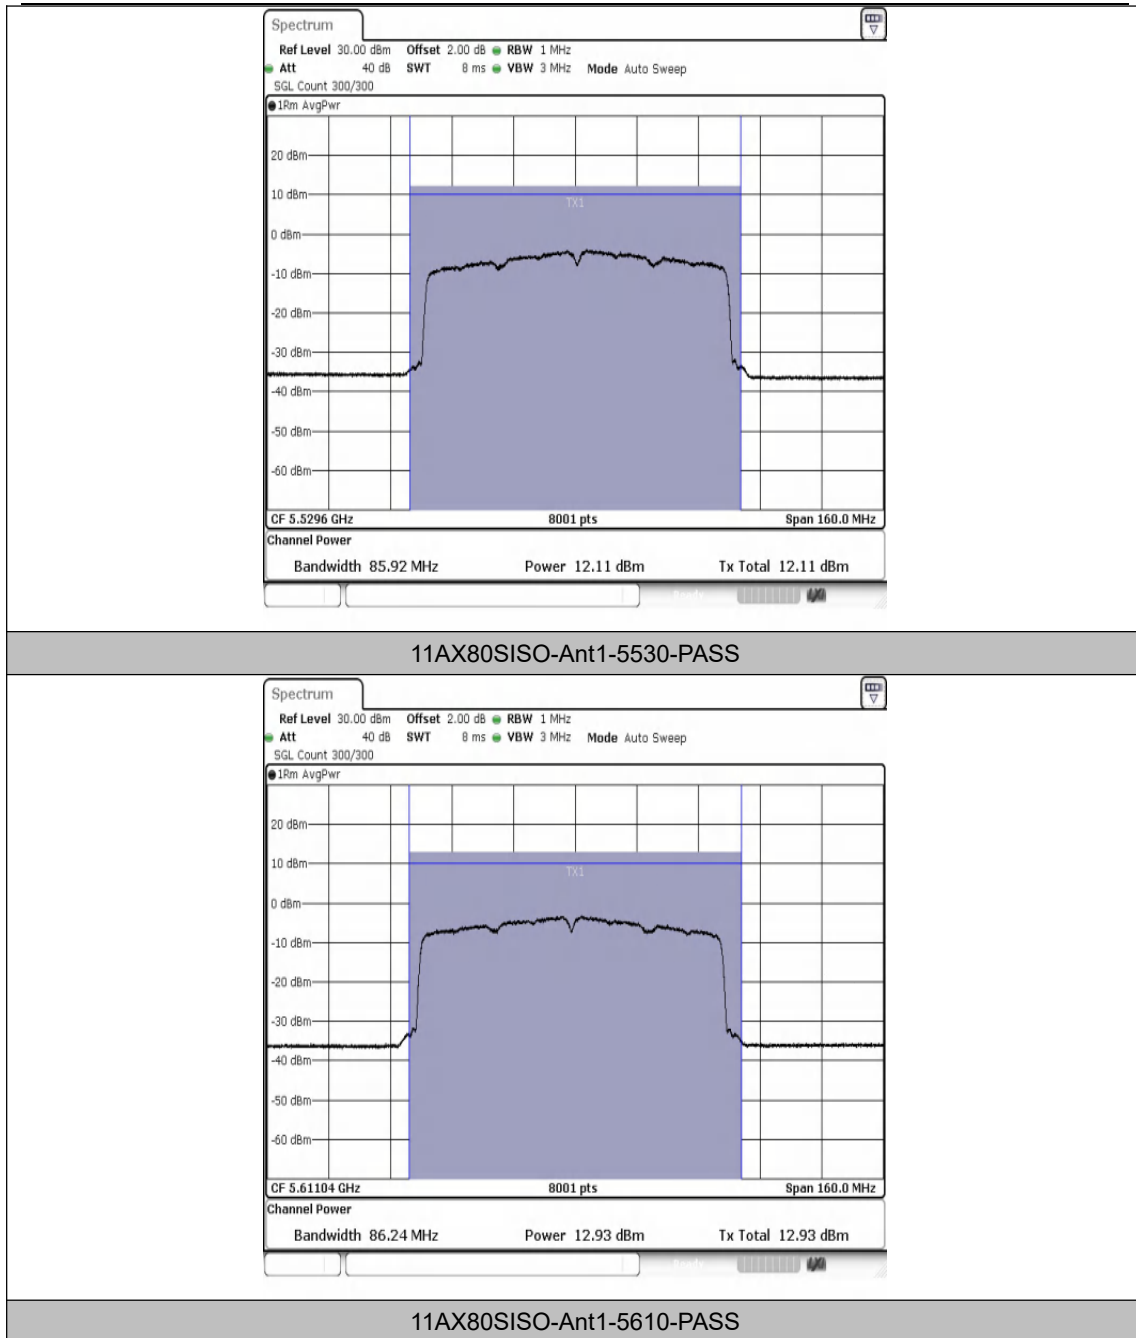

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

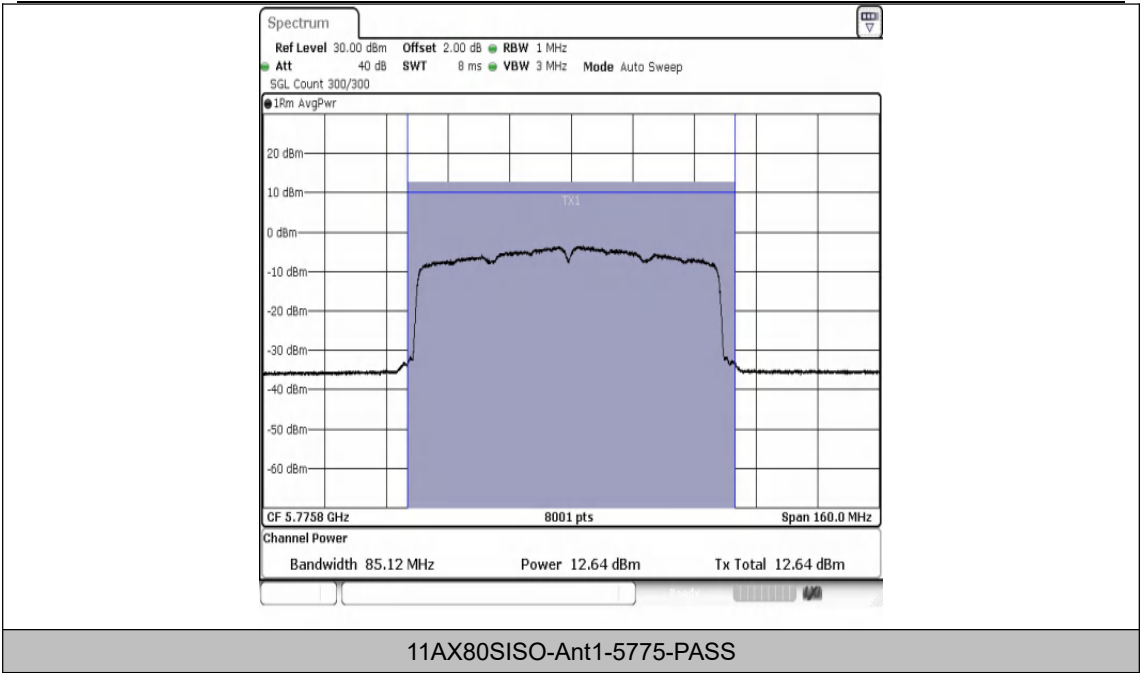

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1/2/3

Test Mode	Antenna	Frequency[MHz]	Reading Result [dBm/MHz]	Result [dBm/MHz]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	3.5	3.50	≤11.00	PASS
11A	Ant1	5200	3.33	3.33	≤11.00	PASS
11A	Ant1	5240	3.27	3.27	≤11.00	PASS
11A	Ant1	5260	4.01	4.01	≤11.00	PASS
11A	Ant1	5280	2.79	2.79	≤11.00	PASS
11A	Ant1	5320	2.44	2.44	≤11.00	PASS
11A	Ant1	5500	2.26	2.26	≤11.00	PASS
11A	Ant1	5580	2.97	2.97	≤11.00	PASS
11A	Ant1	5700	2.85	2.85	≤11.00	PASS
11N20SISO	Ant1	5180	3.28	3.28	≤11.00	PASS
11N20SISO	Ant1	5200	3.56	3.56	≤11.00	PASS
11N20SISO	Ant1	5240	2.72	2.72	≤11.00	PASS
11N20SISO	Ant1	5260	2.98	2.98	≤11.00	PASS
11N20SISO	Ant1	5280	2.76	2.76	≤11.00	PASS
11N20SISO	Ant1	5320	1.97	1.97	≤11.00	PASS
11N20SISO	Ant1	5500	1.99	1.99	≤11.00	PASS
11N20SISO	Ant1	5580	3.44	3.44	≤11.00	PASS
11N20SISO	Ant1	5700	3.22	3.22	≤11.00	PASS
11N40SISO	Ant1	5190	0.35	0.35	≤11.00	PASS
11N40SISO	Ant1	5230	-0.41	-0.41	≤11.00	PASS
11N40SISO	Ant1	5270	-0.38	-0.38	≤11.00	PASS
11N40SISO	Ant1	5310	-0.09	-0.09	≤11.00	PASS
11N40SISO	Ant1	5510	-0.61	-0.61	≤11.00	PASS
11N40SISO	Ant1	5550	-0.48	-0.48	≤11.00	PASS
11N40SISO	Ant1	5670	-0.55	-0.55	≤11.00	PASS
11AC20SISO	Ant1	5180	3.39	3.39	≤11.00	PASS
11AC20SISO	Ant1	5200	3.08	3.08	≤11.00	PASS
11AC20SISO	Ant1	5240	2.84	2.84	≤11.00	PASS
11AC20SISO	Ant1	5260	3.46	3.46	≤11.00	PASS
11AC20SISO	Ant1	5280	2.72	2.72	≤11.00	PASS
11AC20SISO	Ant1	5320	2.24	2.24	≤11.00	PASS
11AC20SISO	Ant1	5500	2.06	2.06	≤11.00	PASS
11AC20SISO	Ant1	5580	3.17	3.17	≤11.00	PASS
11AC20SISO	Ant1	5700	3.38	3.38	≤11.00	PASS
11AC40SISO	Ant1	5190	0.24	0.24	≤11.00	PASS
11AC40SISO	Ant1	5230	0	0.00	≤11.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC40SISO	Ant1	5270	0.13	0.13	≤11.00	PASS
11AC40SISO	Ant1	5310	-0.07	-0.07	≤11.00	PASS
11AC40SISO	Ant1	5510	-0.74	-0.74	≤11.00	PASS
11AC40SISO	Ant1	5550	-0.75	-0.75	≤11.00	PASS
11AC40SISO	Ant1	5670	-0.12	-0.12	≤11.00	PASS
11AC80SISO	Ant1	5210	-3.36	-3.36	≤11.00	PASS
11AC80SISO	Ant1	5290	-3.86	-3.86	≤11.00	PASS
11AC80SISO	Ant1	5530	-3.93	-3.93	≤11.00	PASS
11AC80SISO	Ant1	5610	-3.85	-3.85	≤11.00	PASS
11AX20SISO	Ant1	5180	2.89	2.89	≤11.00	PASS
11AX20SISO	Ant1	5200	2.78	2.78	≤11.00	PASS
11AX20SISO	Ant1	5240	2.27	2.27	≤11.00	PASS
11AX20SISO	Ant1	5260	2.39	2.39	≤11.00	PASS
11AX20SISO	Ant1	5280	2.78	2.78	≤11.00	PASS
11AX20SISO	Ant1	5320	2.89	2.89	≤11.00	PASS
11AX20SISO	Ant1	5500	2.09	2.09	≤11.00	PASS
11AX20SISO	Ant1	5580	2.65	2.65	≤11.00	PASS
11AX20SISO	Ant1	5700	2.41	2.41	≤11.00	PASS
11AX40SISO	Ant1	5190	0.59	0.59	≤11.00	PASS
11AX40SISO	Ant1	5230	-0.13	-0.13	≤11.00	PASS
11AX40SISO	Ant1	5270	-0.4	-0.40	≤11.00	PASS
11AX40SISO	Ant1	5310	-0.39	-0.39	≤11.00	PASS
11AX40SISO	Ant1	5510	-0.98	-0.98	≤11.00	PASS
11AX40SISO	Ant1	5550	-1.07	-1.07	≤11.00	PASS
11AX40SISO	Ant1	5670	0.8	0.80	≤11.00	PASS
11AX80SISO	Ant1	5210	-3.39	-3.39	≤11.00	PASS
11AX80SISO	Ant1	5290	-4.1	-4.10	≤11.00	PASS
11AX80SISO	Ant1	5530	-3.31	-3.31	≤11.00	PASS
11AX80SISO	Ant1	5610	-3.26	-3.26	≤11.00	PASS


Note: 1.The cable loss are compensated in the graph.

Test Result B4

Test Mode	Antenna	Frequency[MHz]	Reading Result [dBm/500KHz]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	0.15	0.15	≤30.00	PASS
11A	Ant1	5785	-0.17	-0.17	≤30.00	PASS
11A	Ant1	5825	-0.23	-0.23	≤30.00	PASS
11N20SISO	Ant1	5745	0.32	0.32	≤30.00	PASS
11N20SISO	Ant1	5785	0.18	0.18	≤30.00	PASS
11N20SISO	Ant1	5825	0.17	0.17	≤30.00	PASS
11N40SISO	Ant1	5755	-2.27	-2.27	≤30.00	PASS
11N40SISO	Ant1	5795	-2.53	-2.53	≤30.00	PASS
11AC20SISO	Ant1	5745	0.23	0.23	≤30.00	PASS
11AC20SISO	Ant1	5785	0.01	0.01	≤30.00	PASS
11AC20SISO	Ant1	5825	-0.18	-0.18	≤30.00	PASS
11AC40SISO	Ant1	5755	-2.8	-2.80	≤30.00	PASS
11AC40SISO	Ant1	5795	-2.41	-2.41	≤30.00	PASS
11AC80SISO	Ant1	5775	-5.94	-5.94	≤30.00	PASS
11AX20SISO	Ant1	5745	-0.05	-0.05	≤30.00	PASS
11AX20SISO	Ant1	5785	-0.15	-0.15	≤30.00	PASS
11AX20SISO	Ant1	5825	0.13	0.13	≤30.00	PASS
11AX40SISO	Ant1	5755	-2.76	-2.76	≤30.00	PASS
11AX40SISO	Ant1	5795	-2.58	-2.58	≤30.00	PASS
11AX80SISO	Ant1	5775	-6.34	-6.34	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Graphs B1/2/3

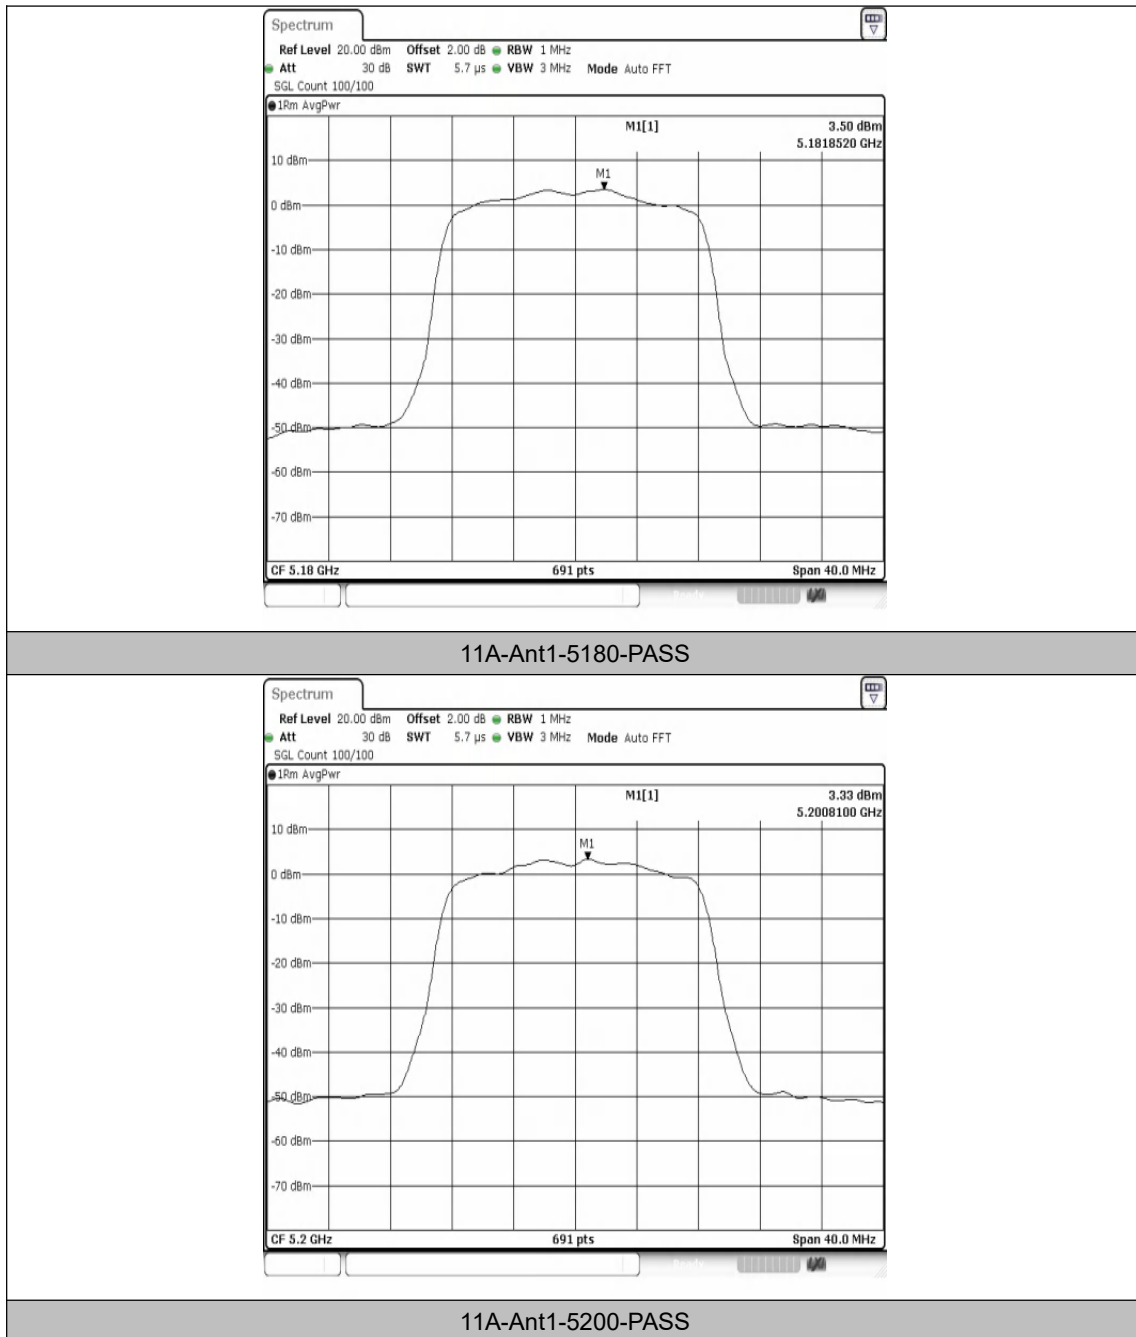


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

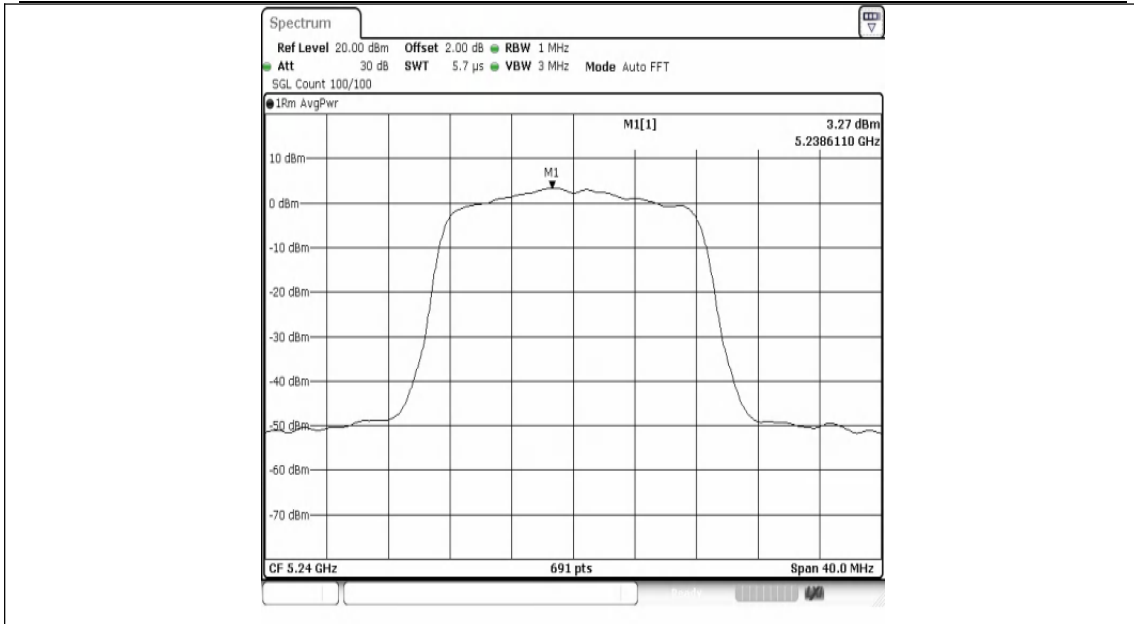


11A-Ant1-5240-PASS

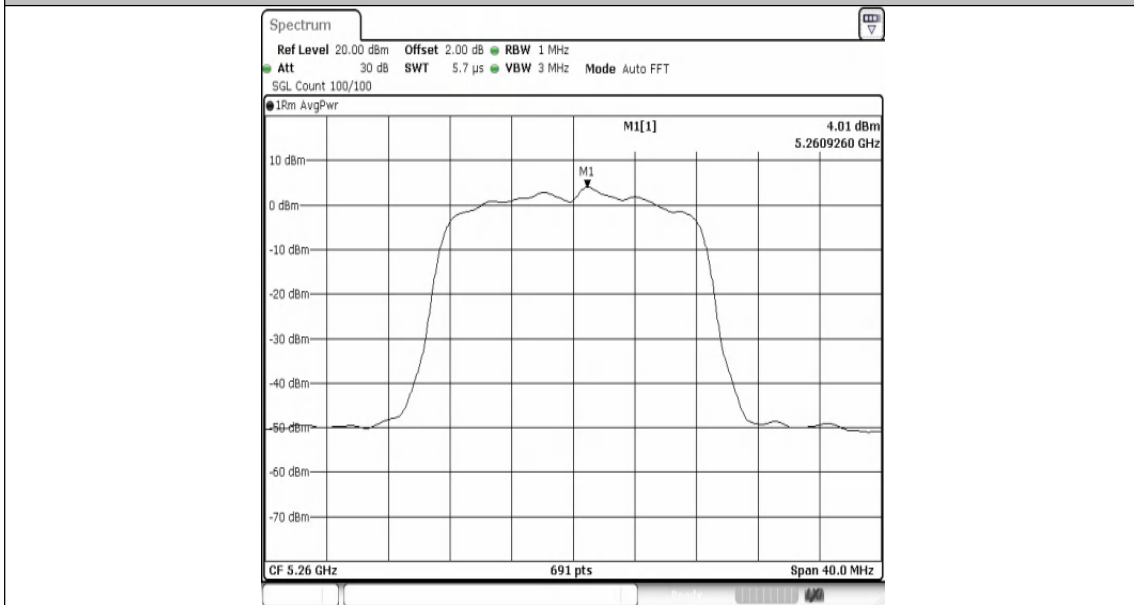


11A-Ant1-5260-PASS

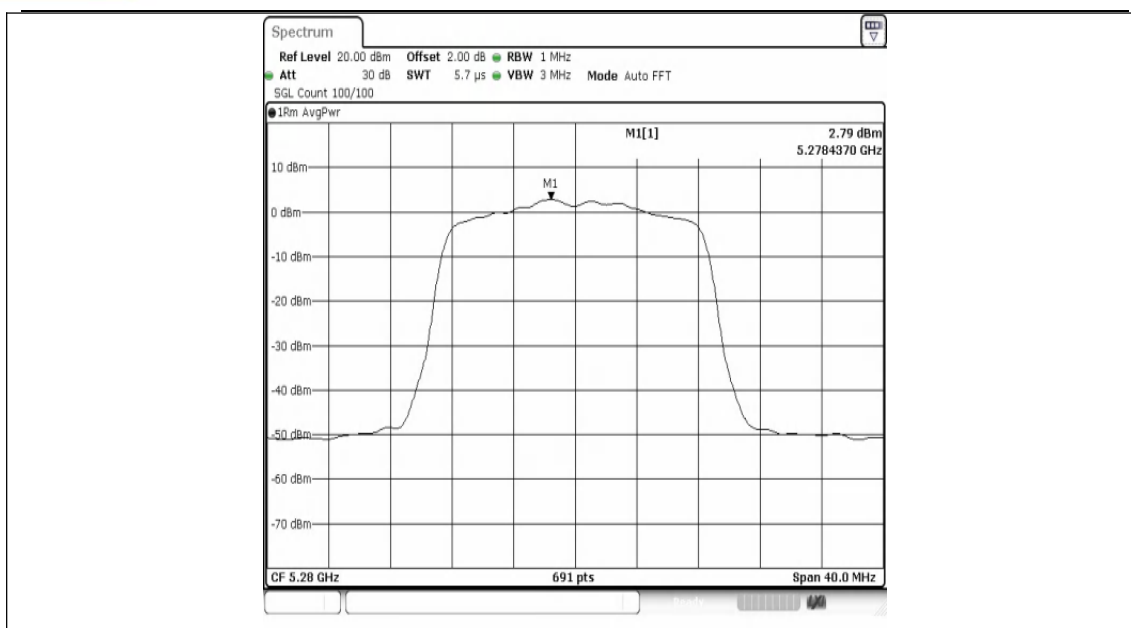

11A-Ant1-5280-PASS

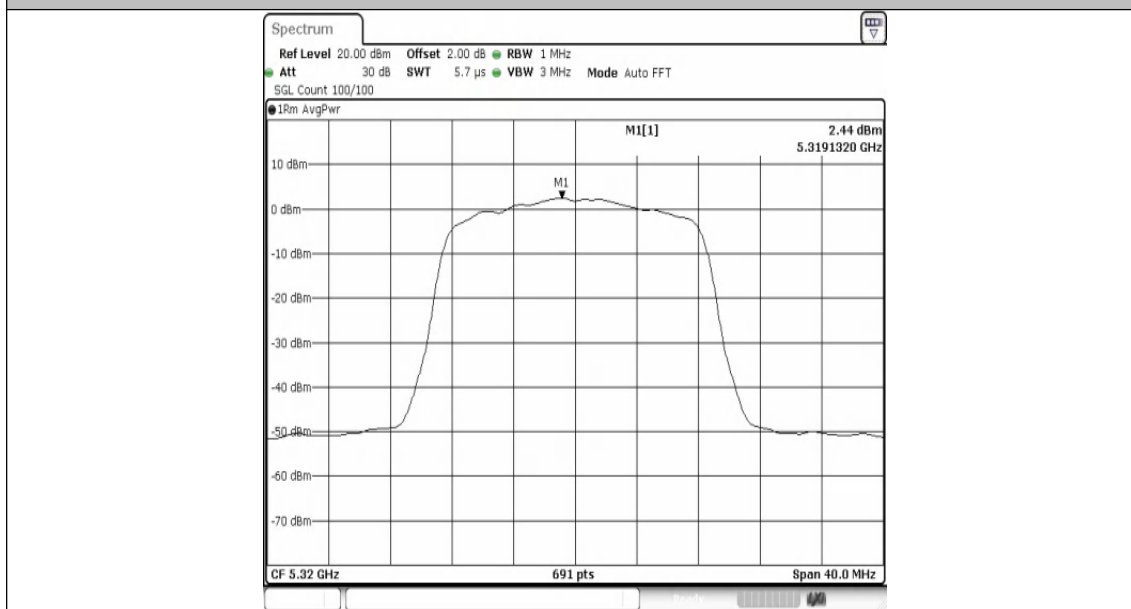


11A-Ant1-5320-PASS

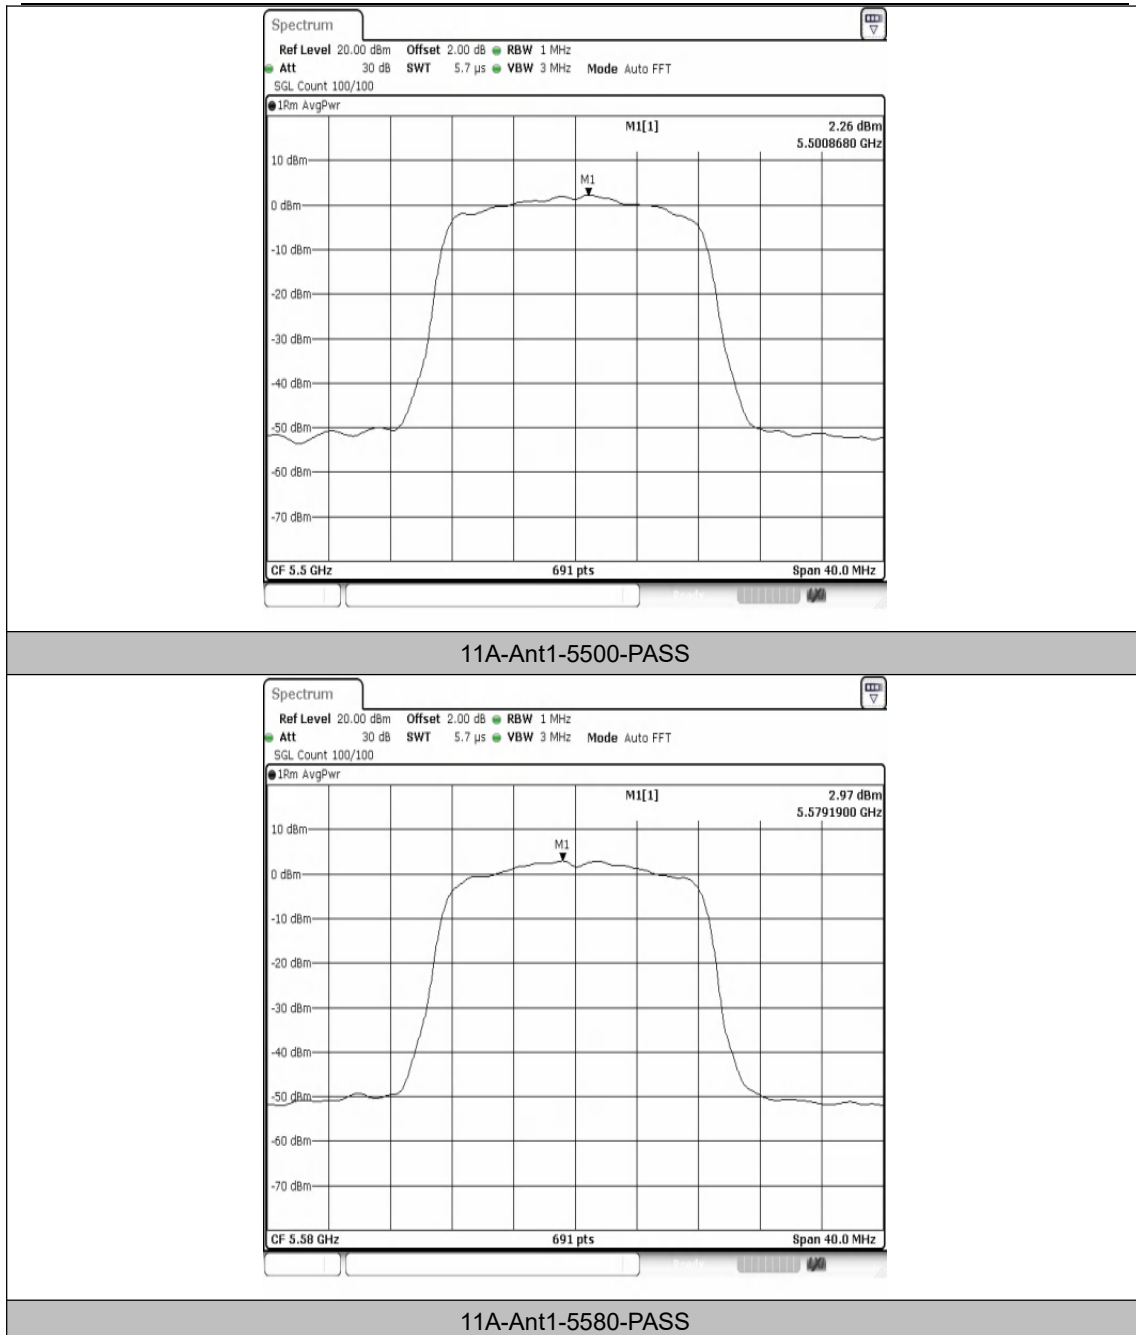


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

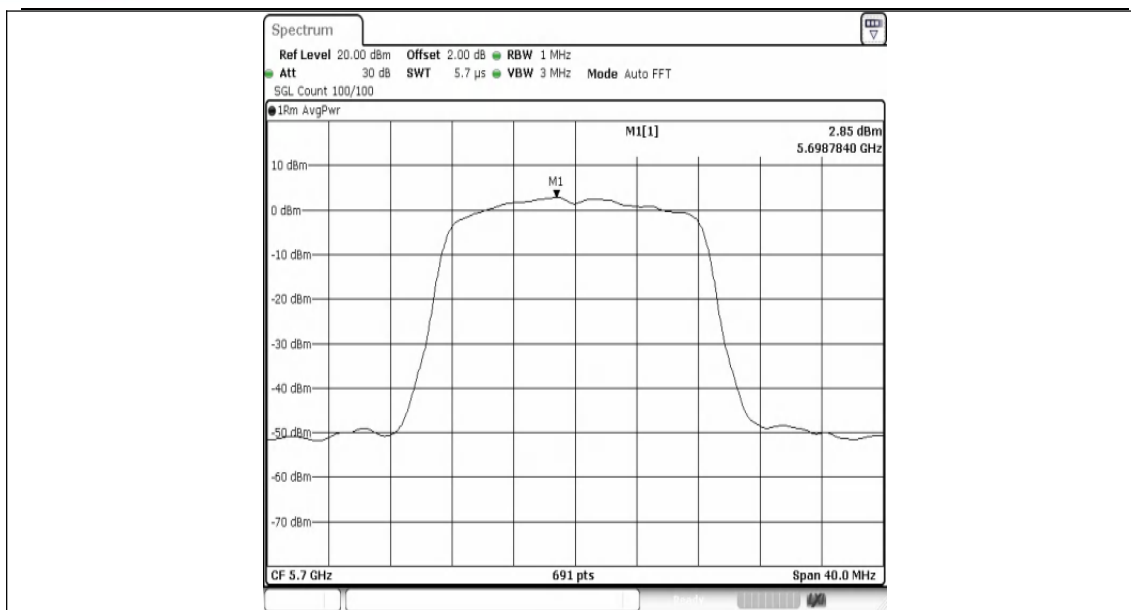

11A-Ant1-5700-PASS

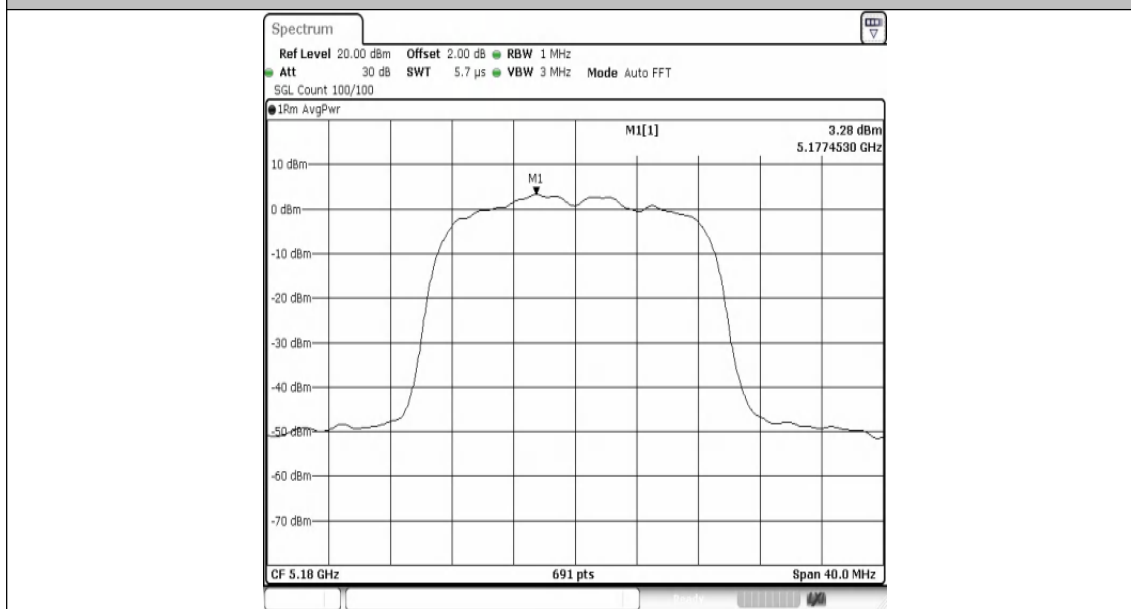


11N20SISO-Ant1-5180-PASS

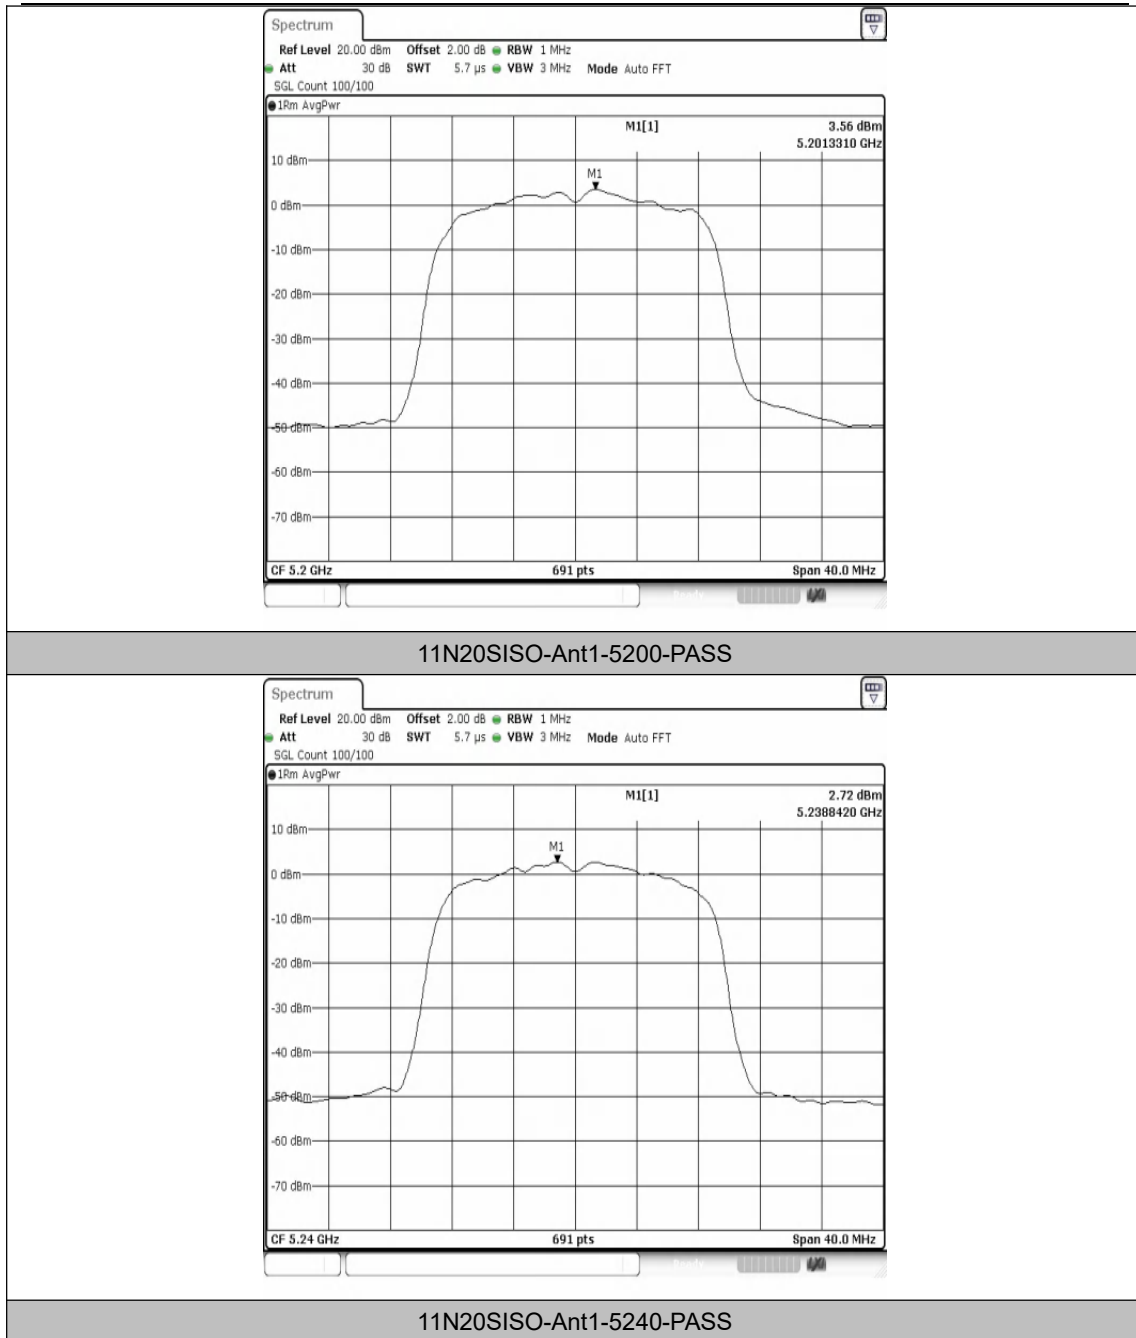


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

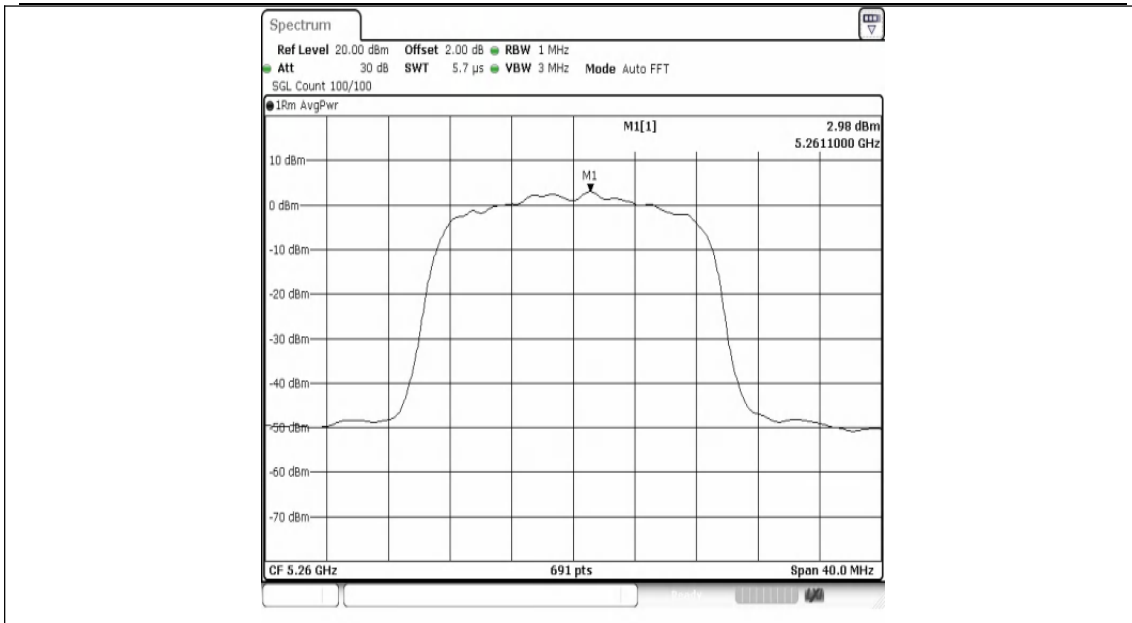


11N20SISO-Ant1-5260-PASS

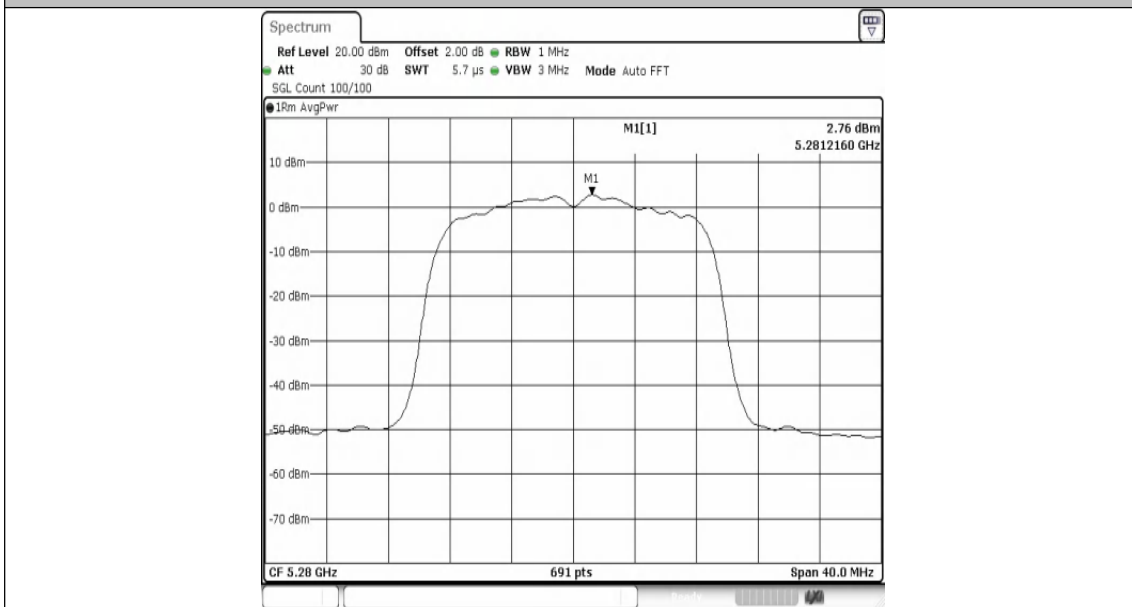


11N20SISO-Ant1-5280-PASS

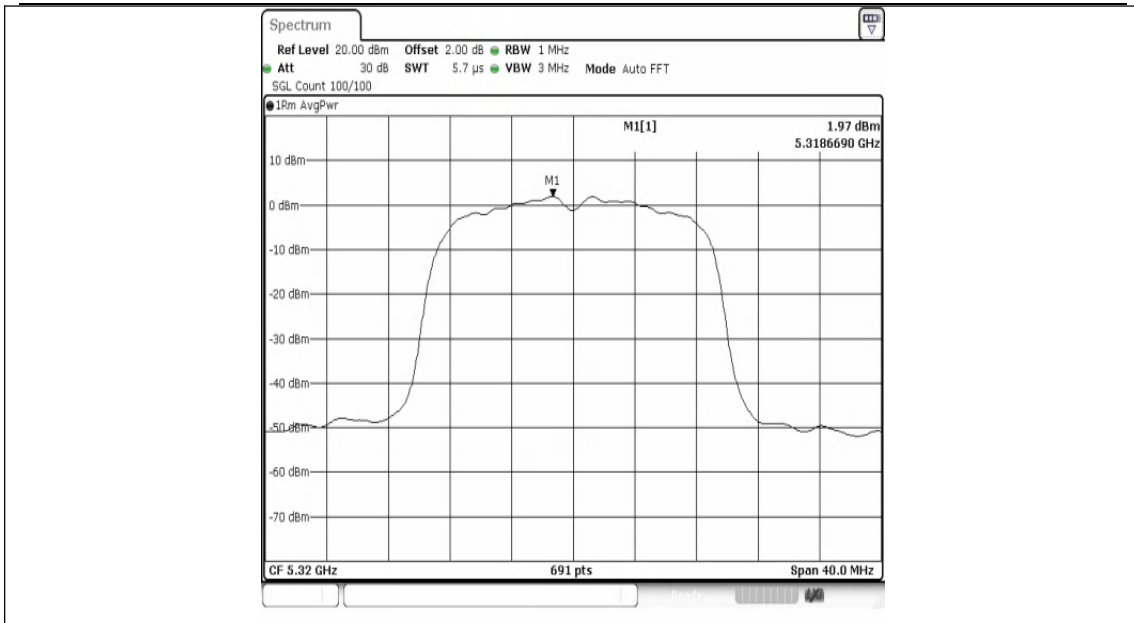


11N20SISO-Ant1-5320-PASS

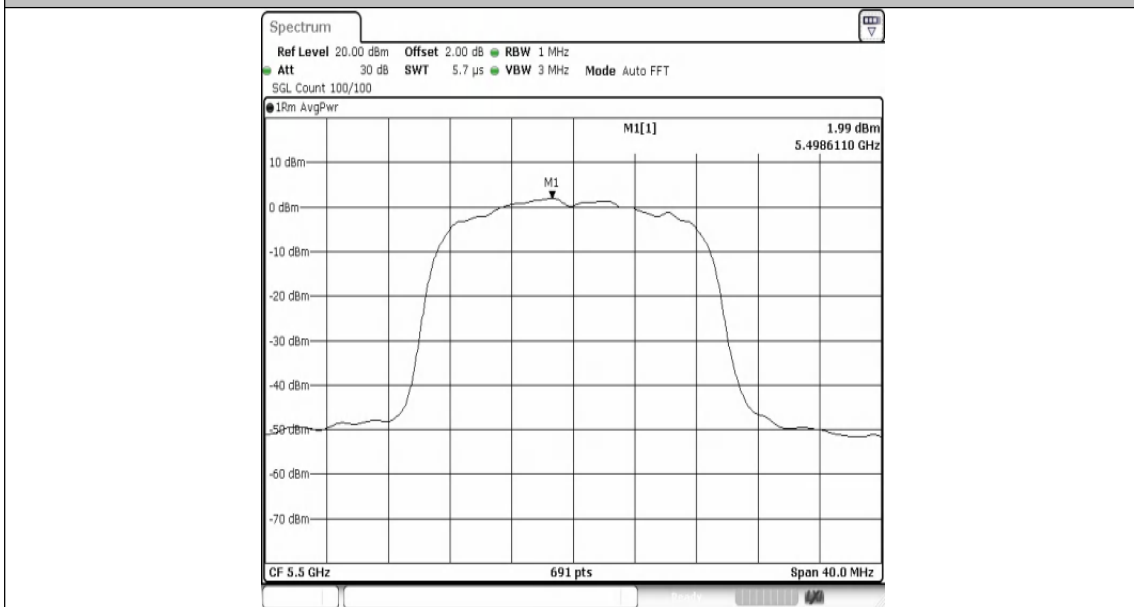

11N20SISO-Ant1-5500-PASS

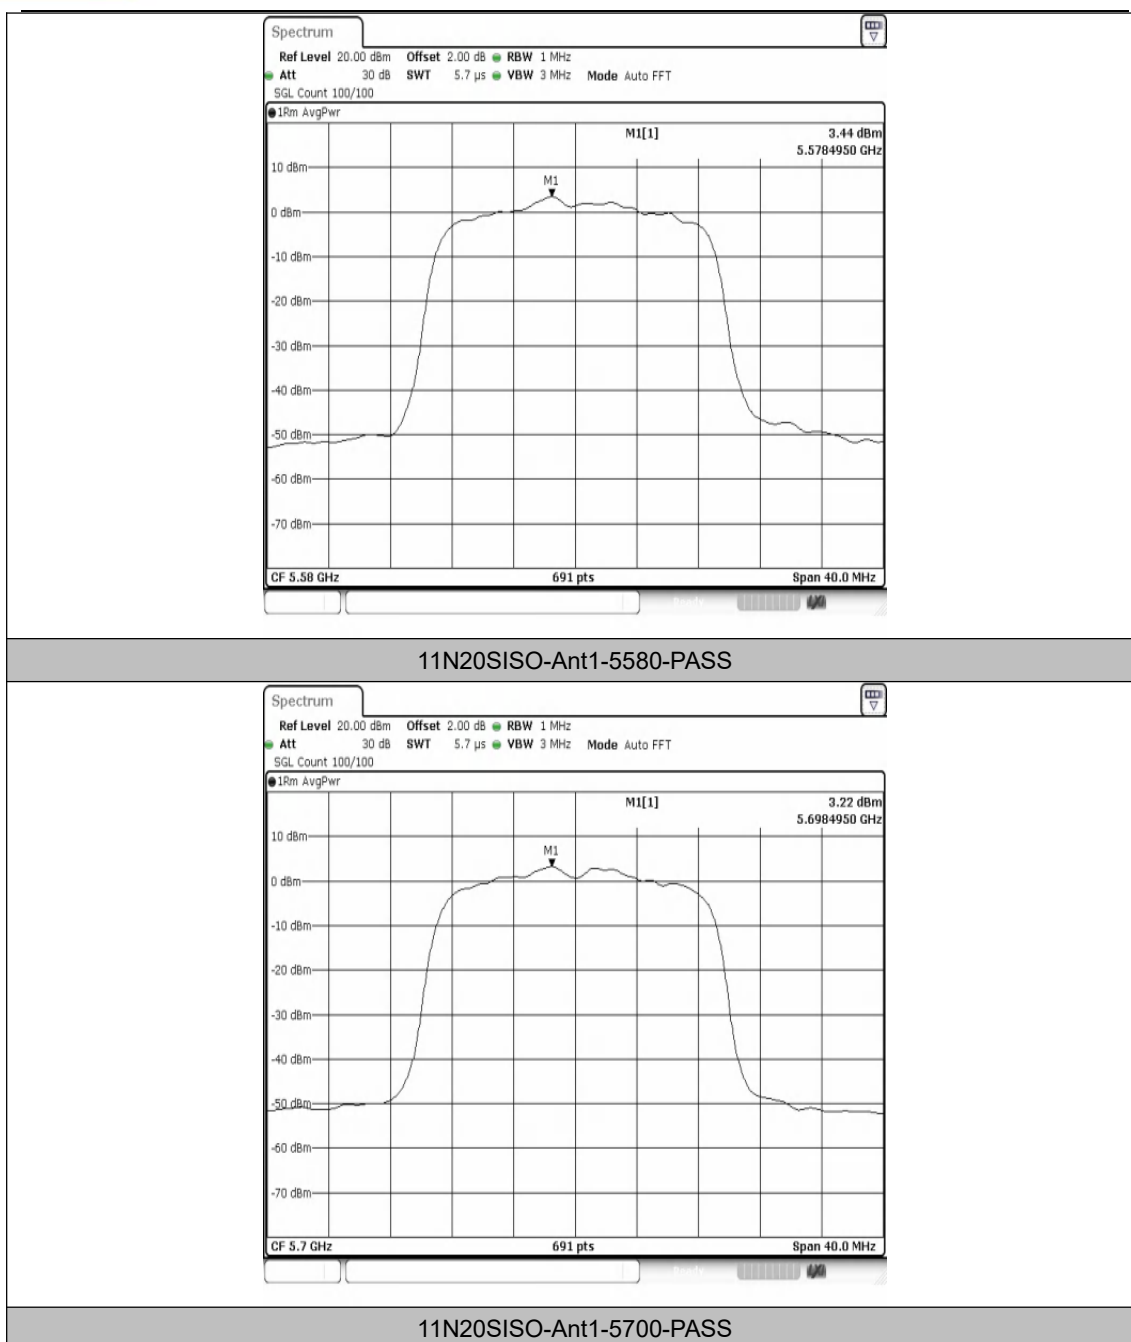


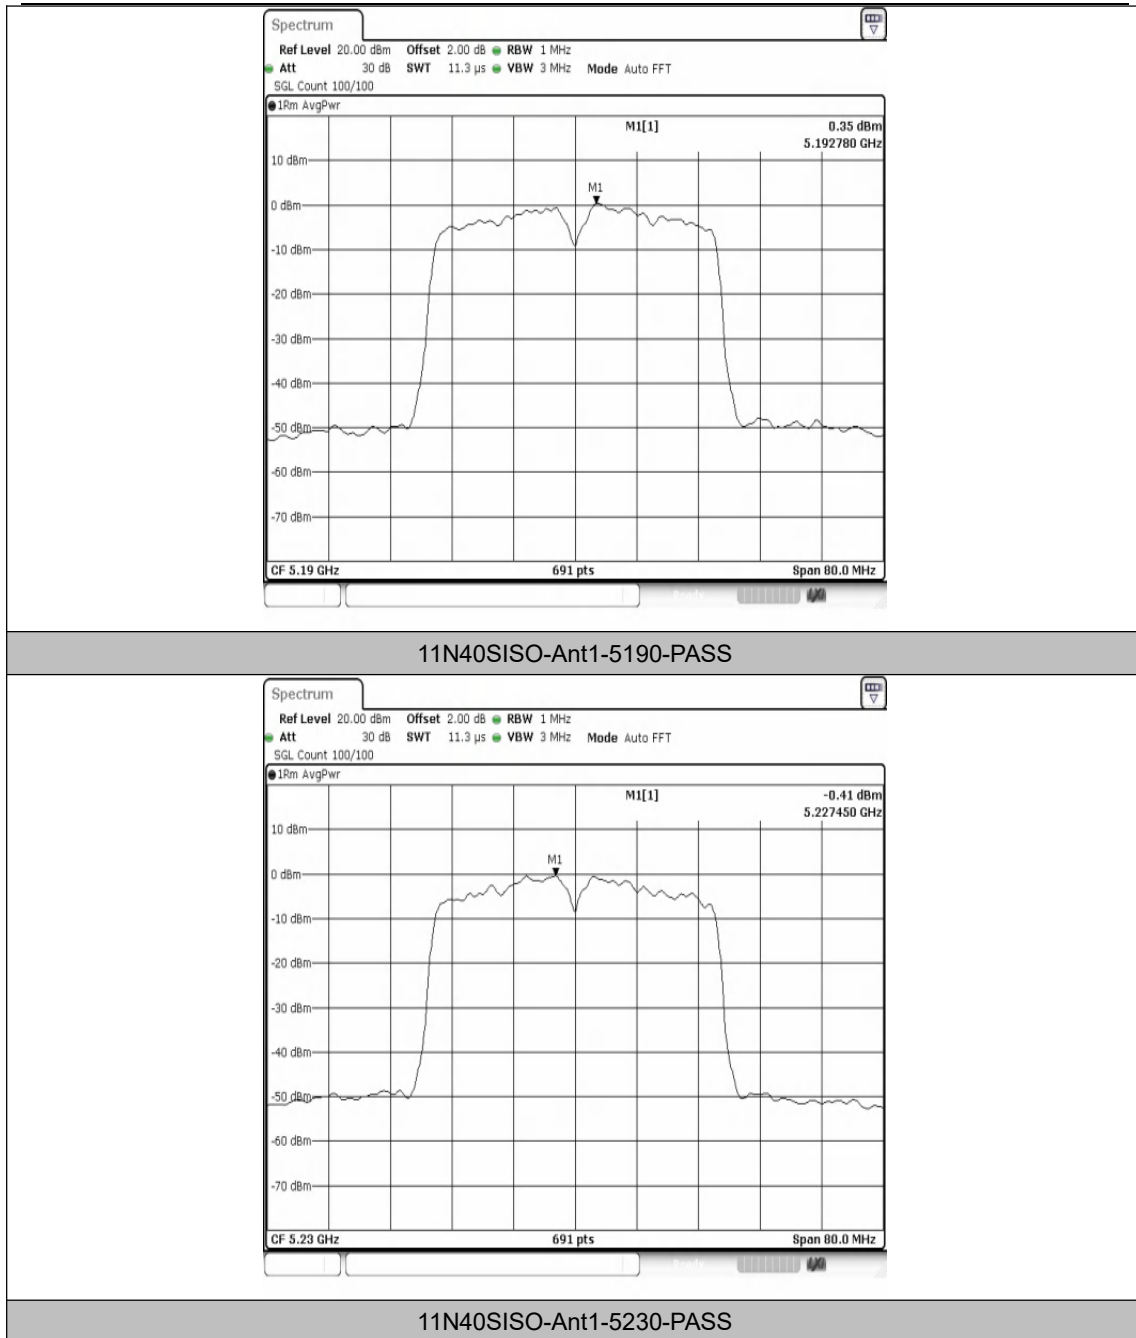


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

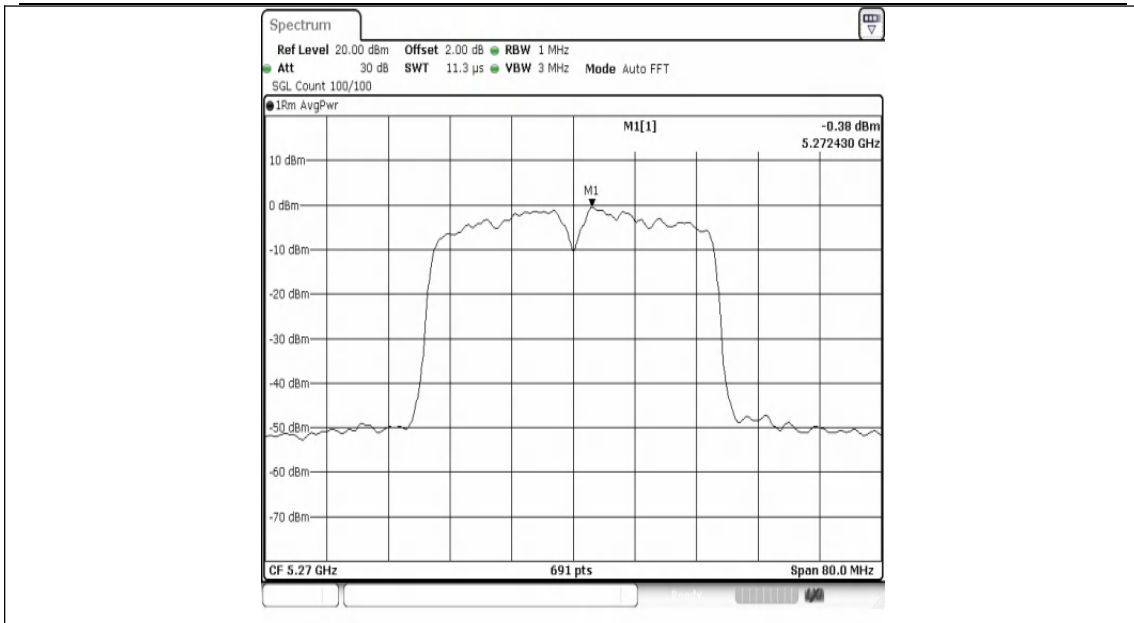

11N40SISO-Ant1-5270-PASS

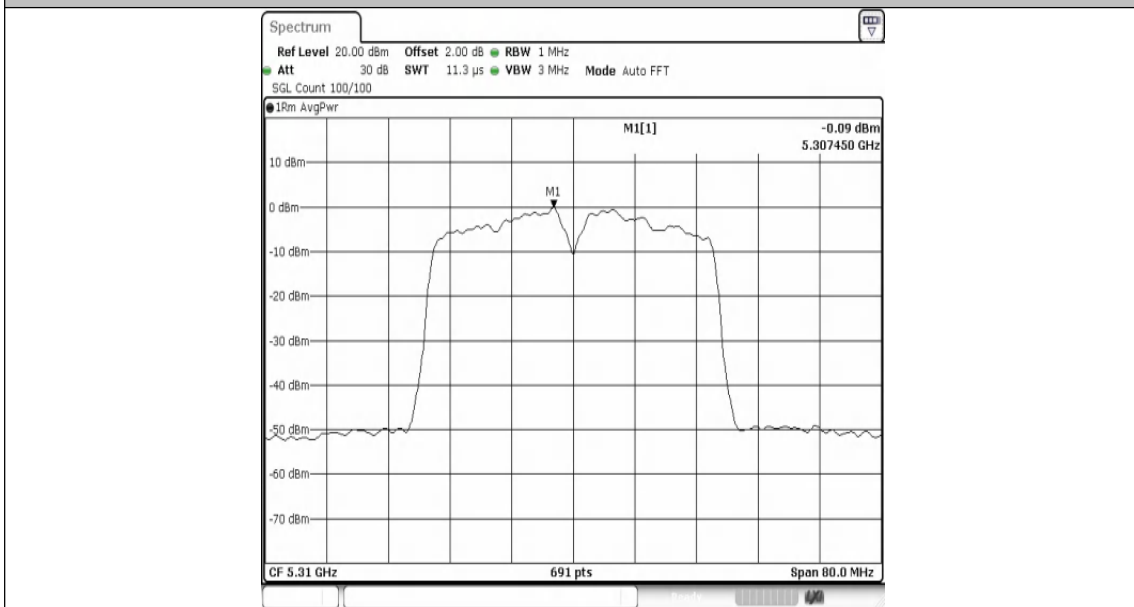


11N40SISO-Ant1-5310-PASS

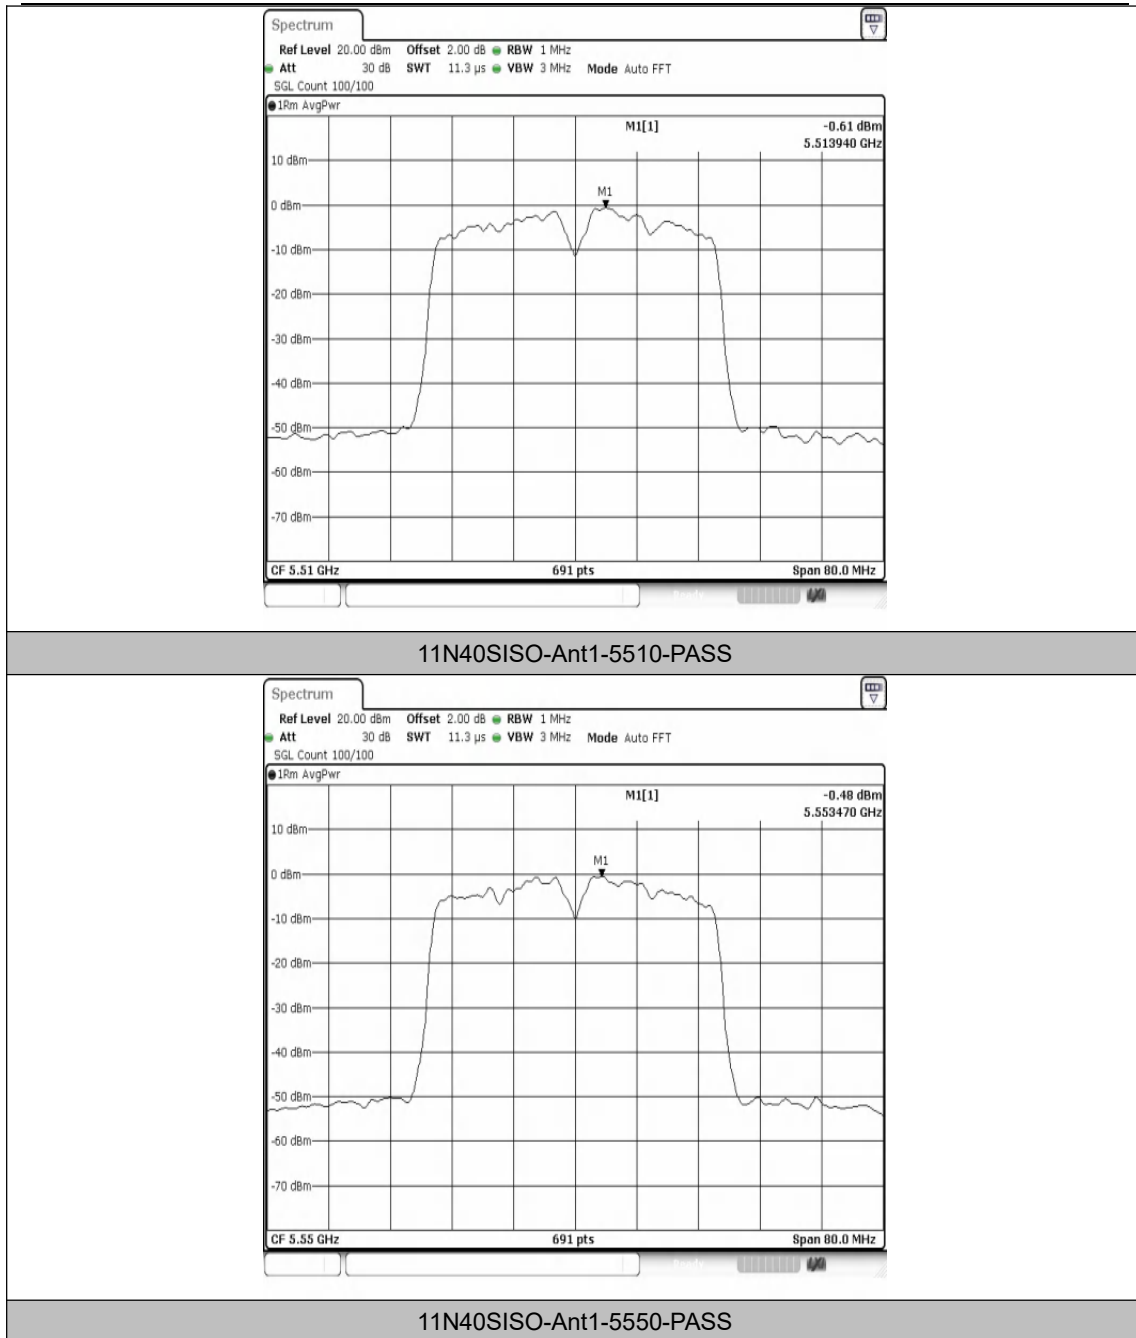



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

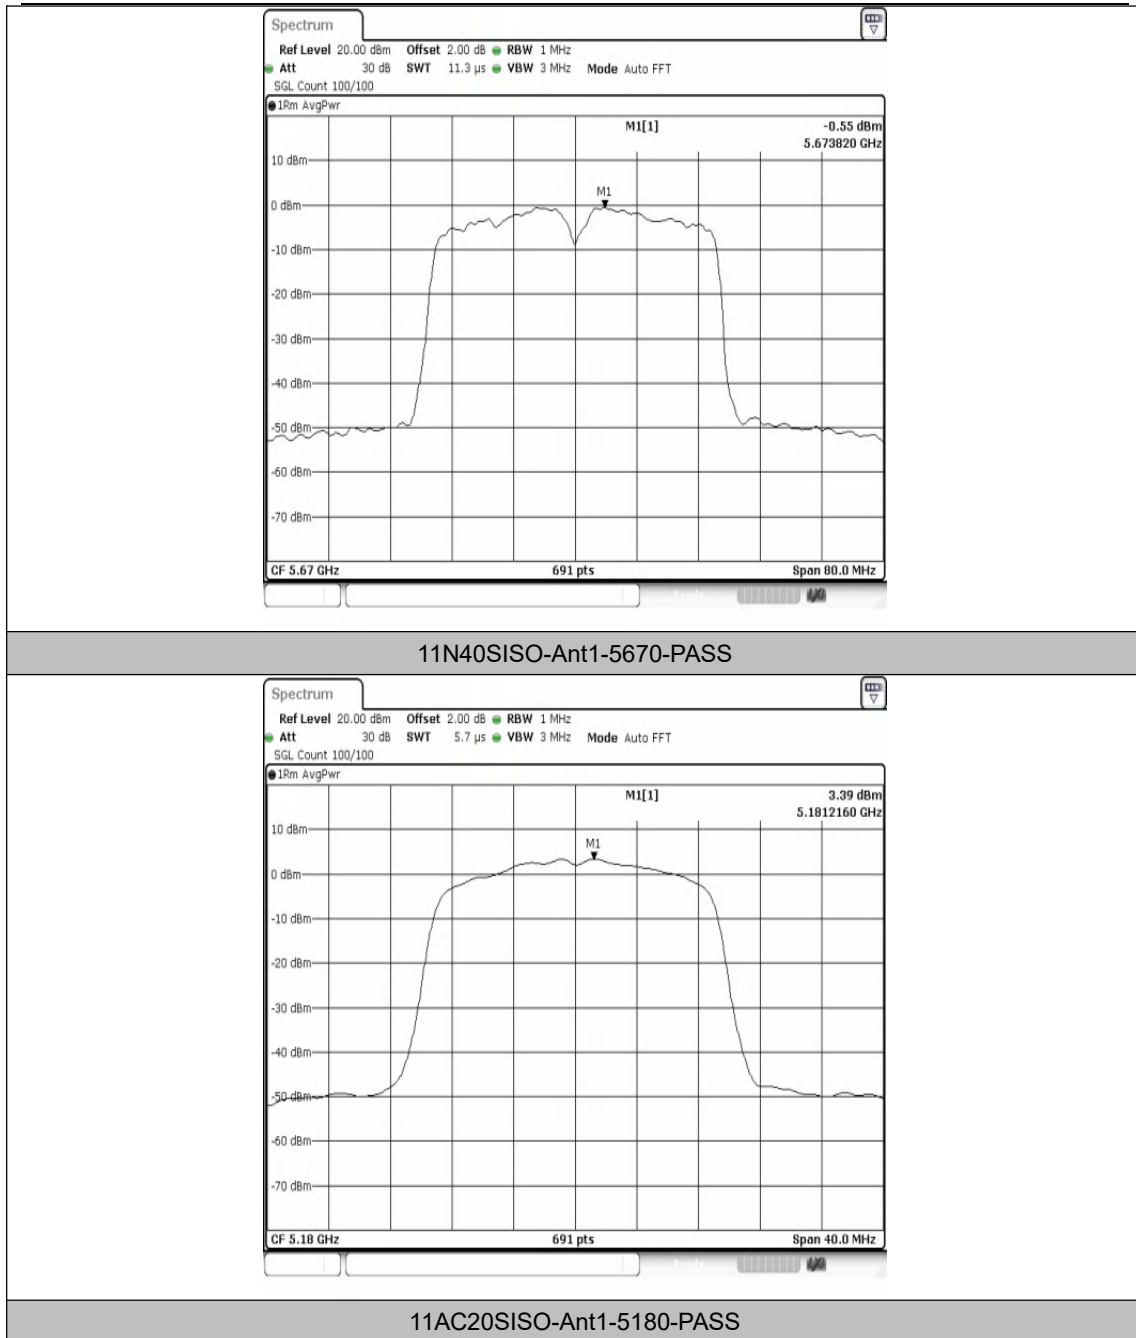

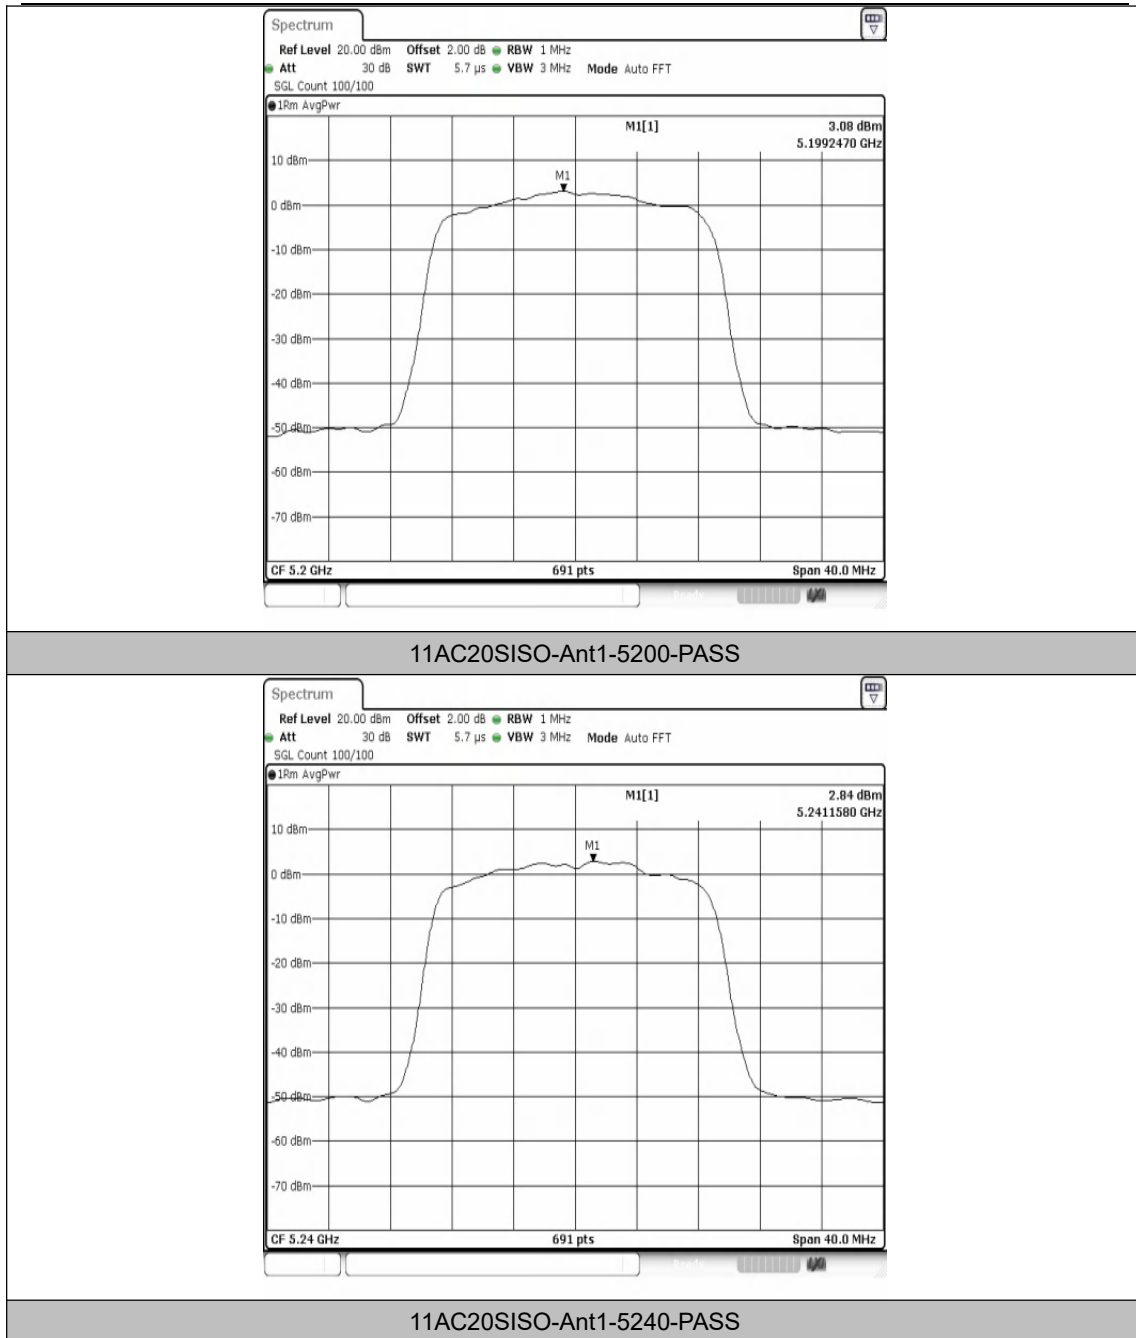


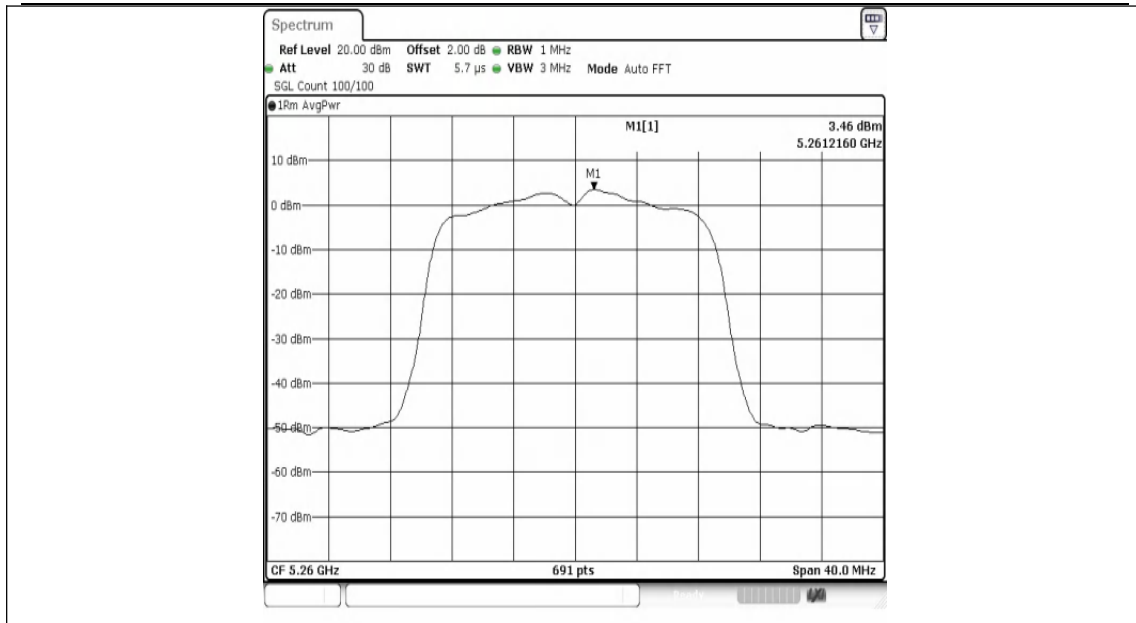

11AC20SISO-Ant1-5260-PASS

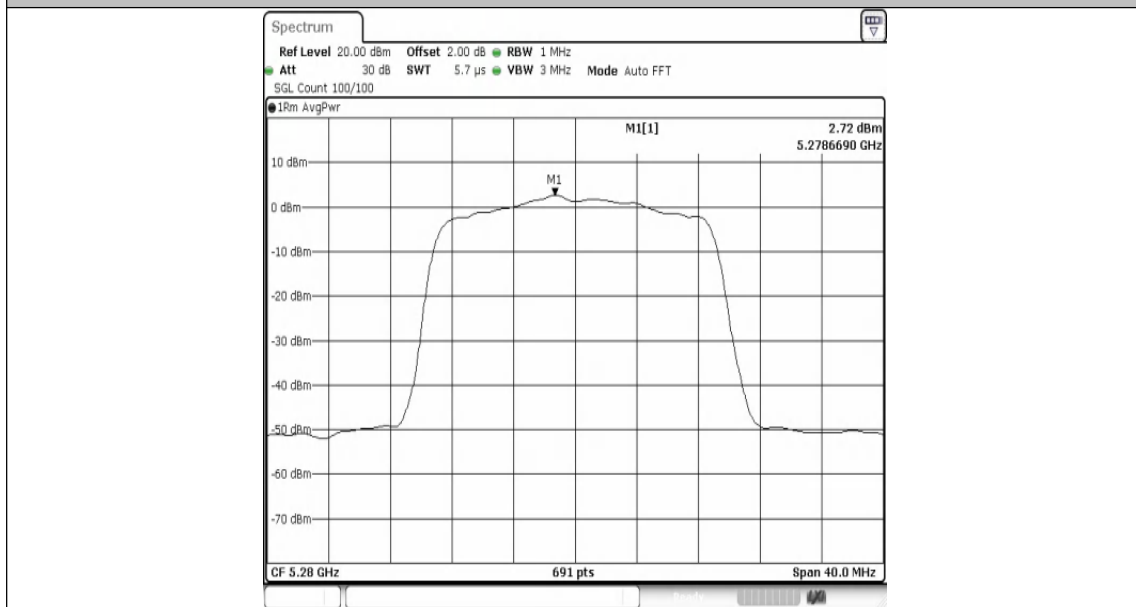


11AC20SISO-Ant1-5280-PASS

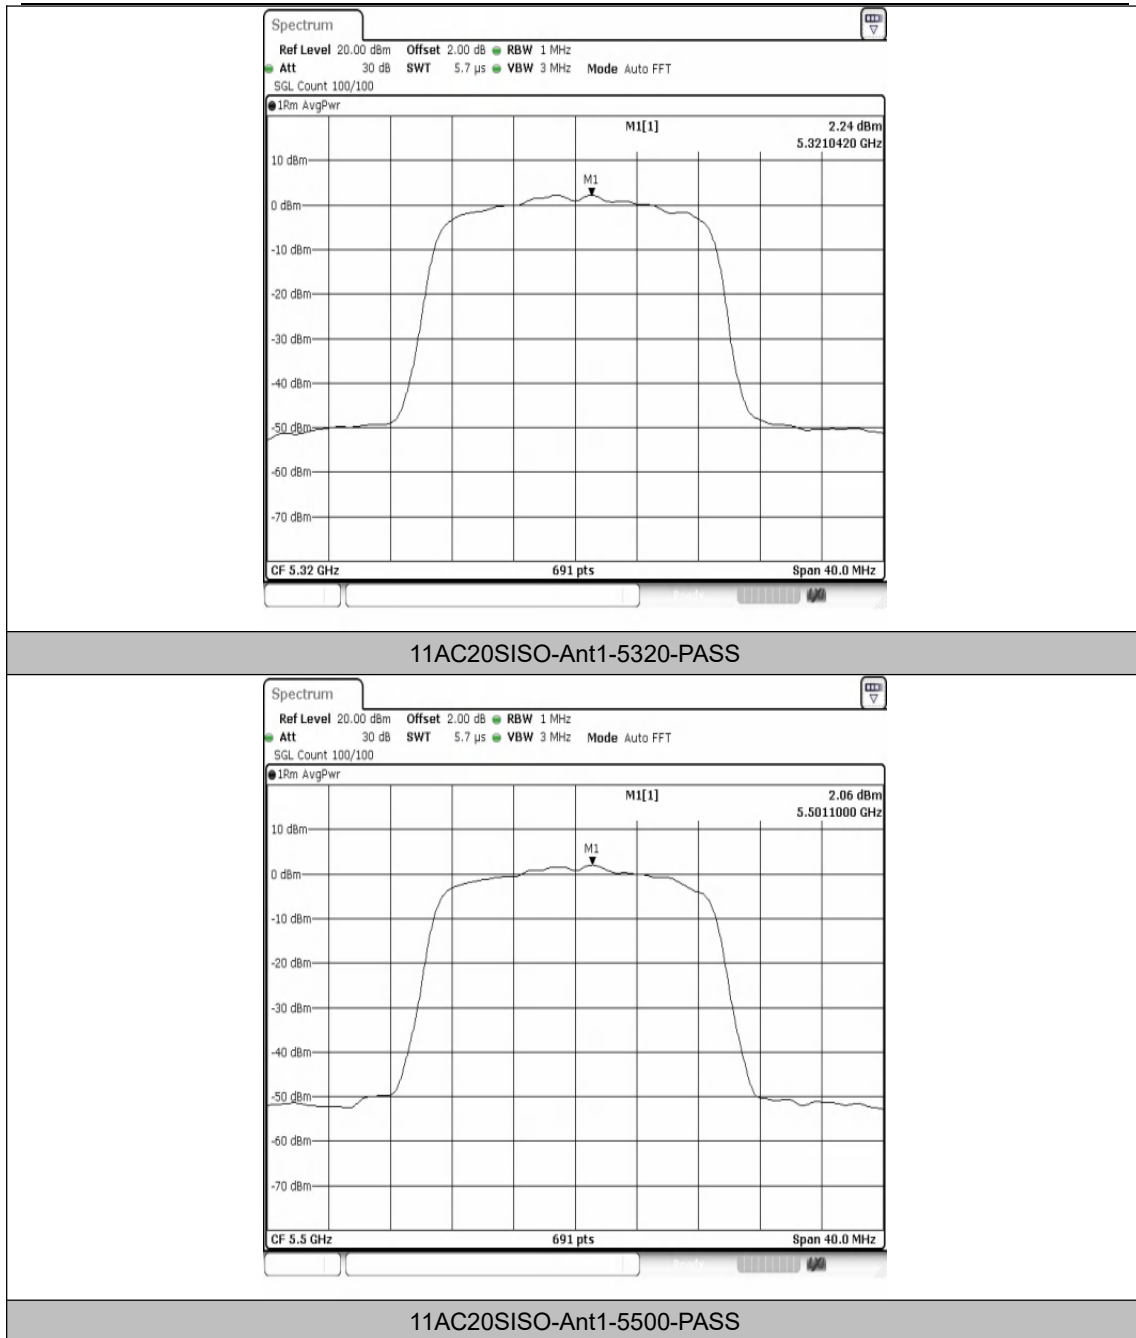


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

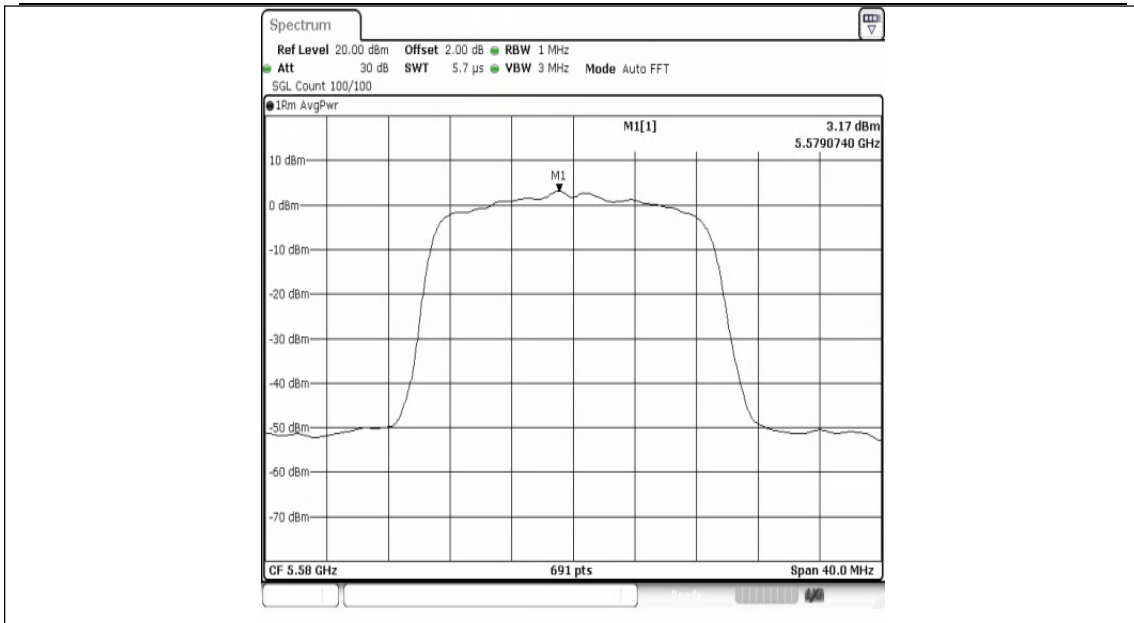


11AC20SISO-Ant1-5580-PASS

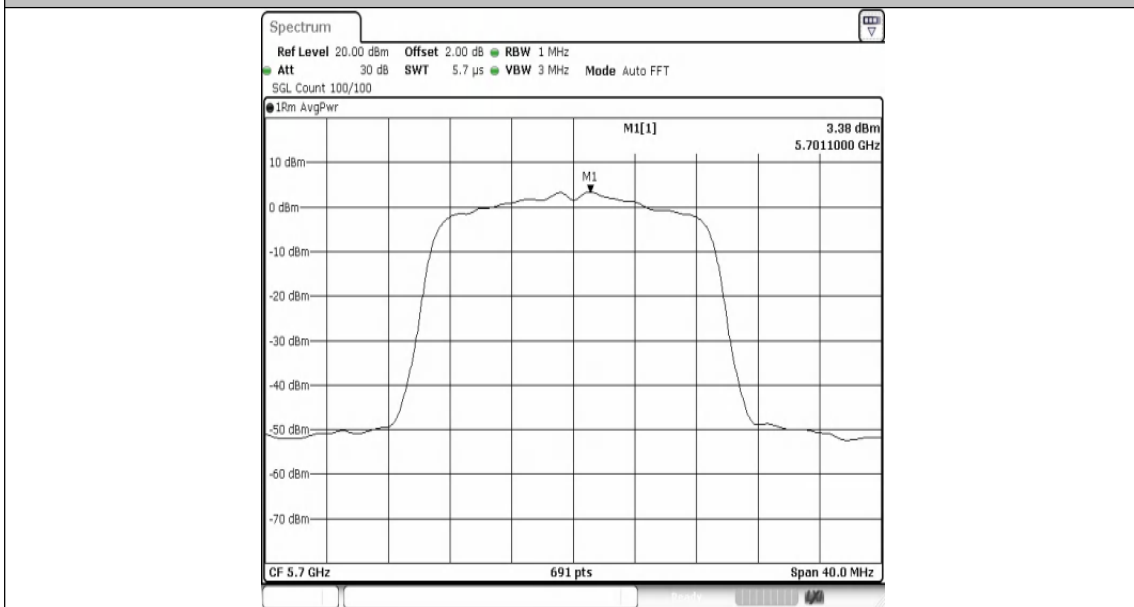


11AC20SISO-Ant1-5700-PASS

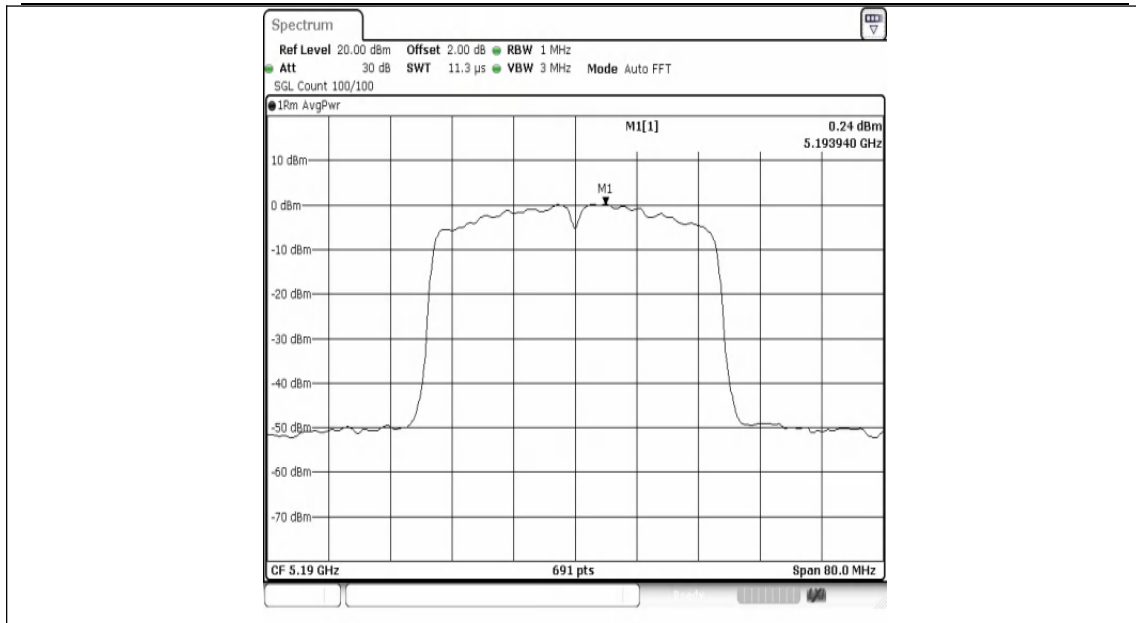


11AC40SISO-Ant1-5190-PASS

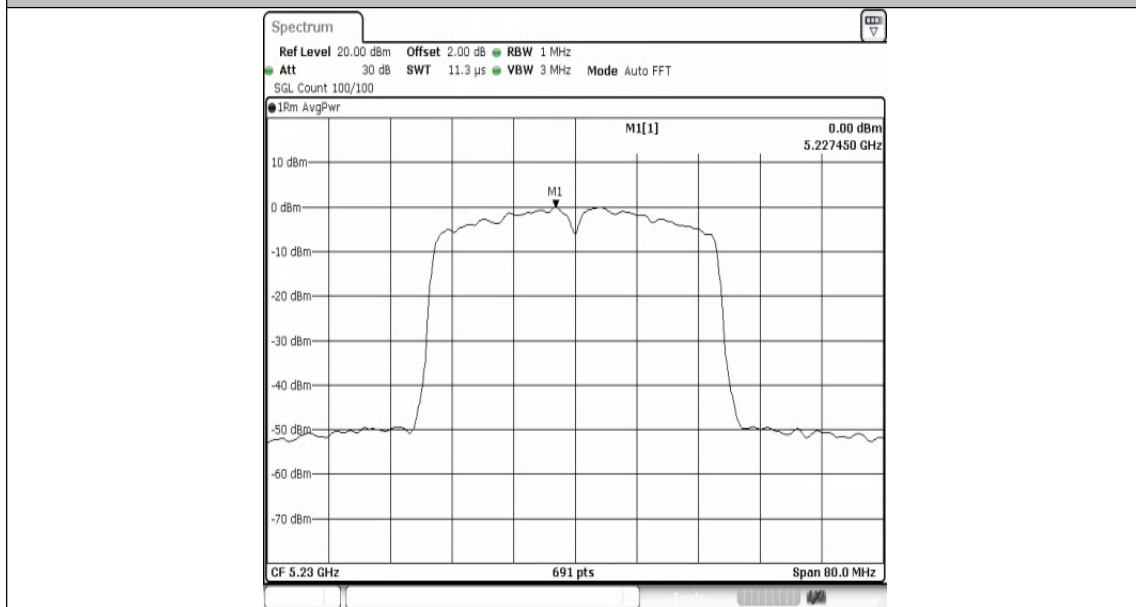


11AC40SISO-Ant1-5230-PASS

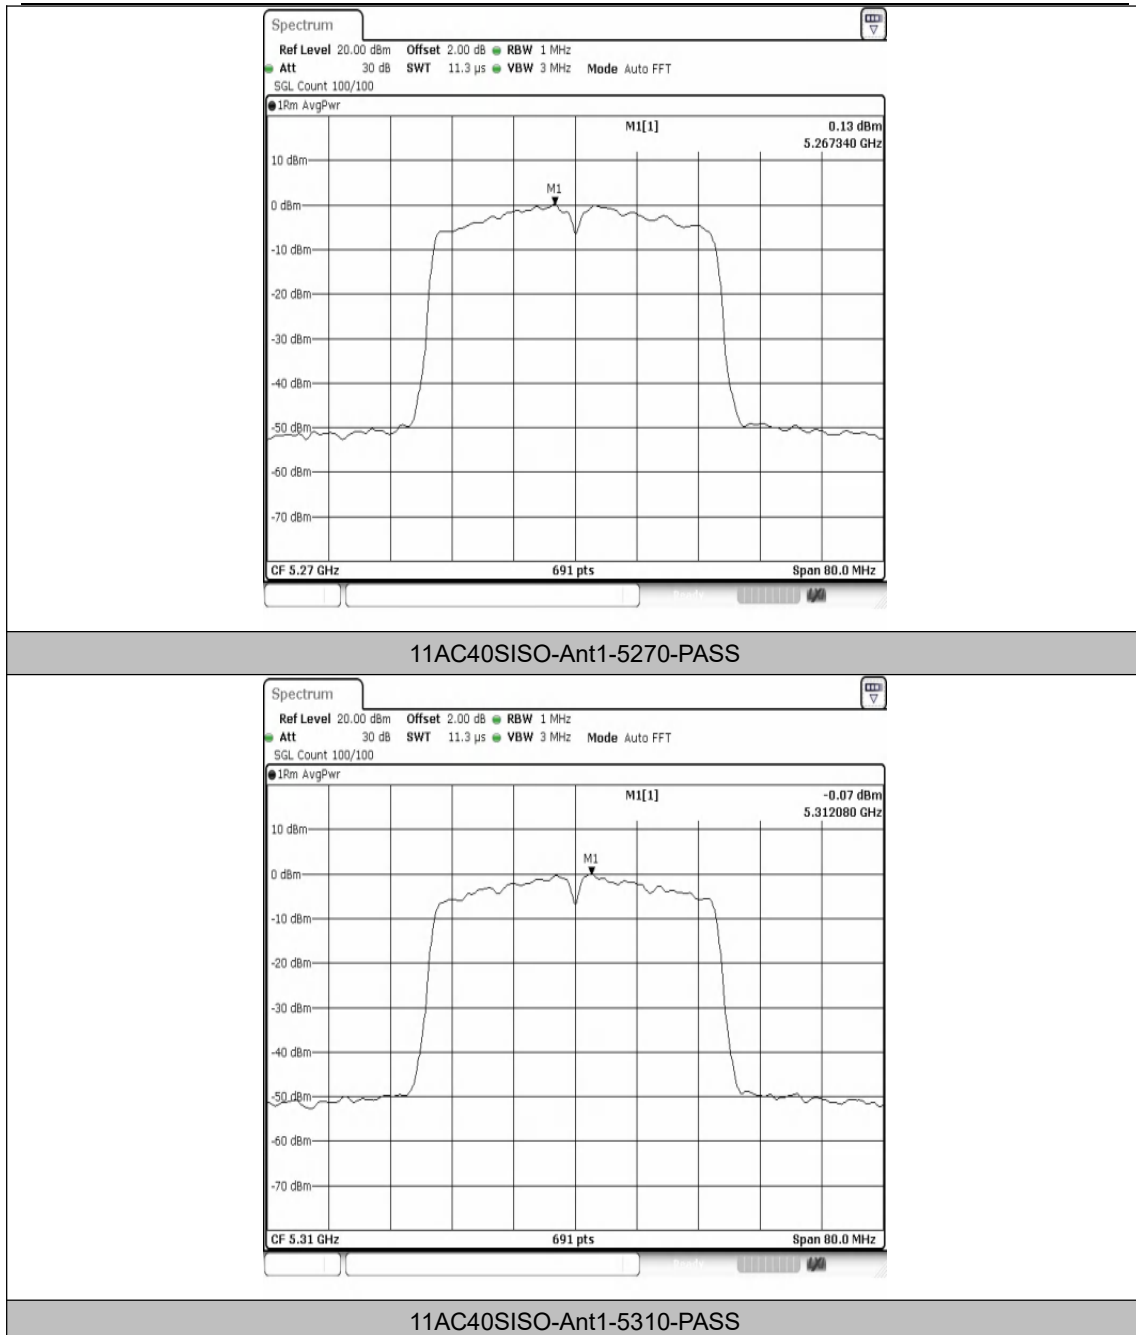


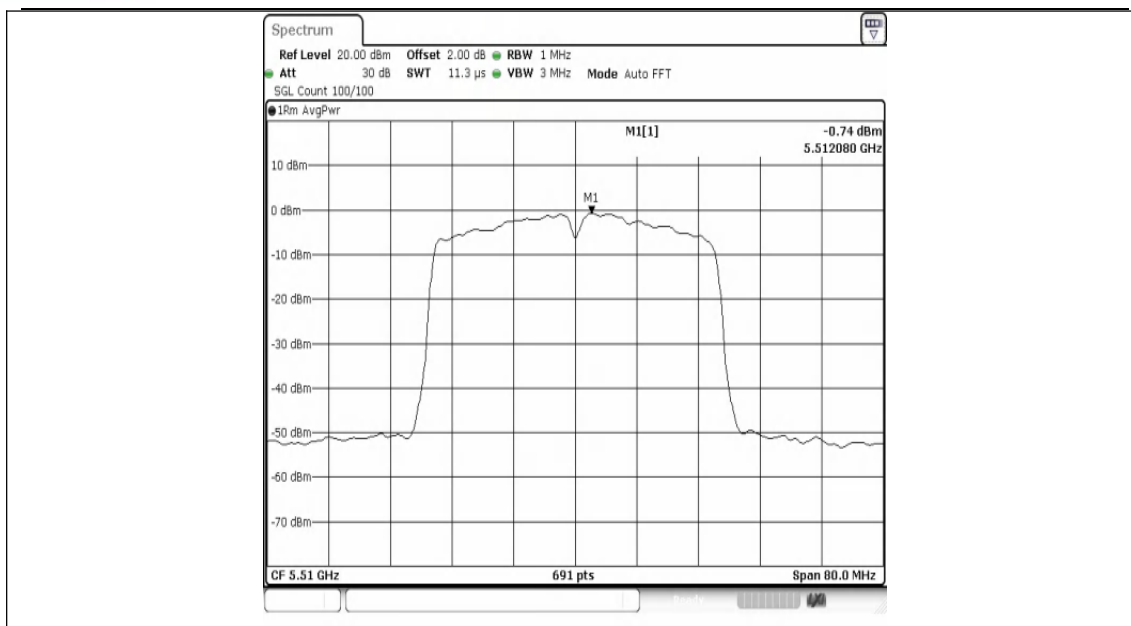


11AC40SISO-Ant1-5510-PASS

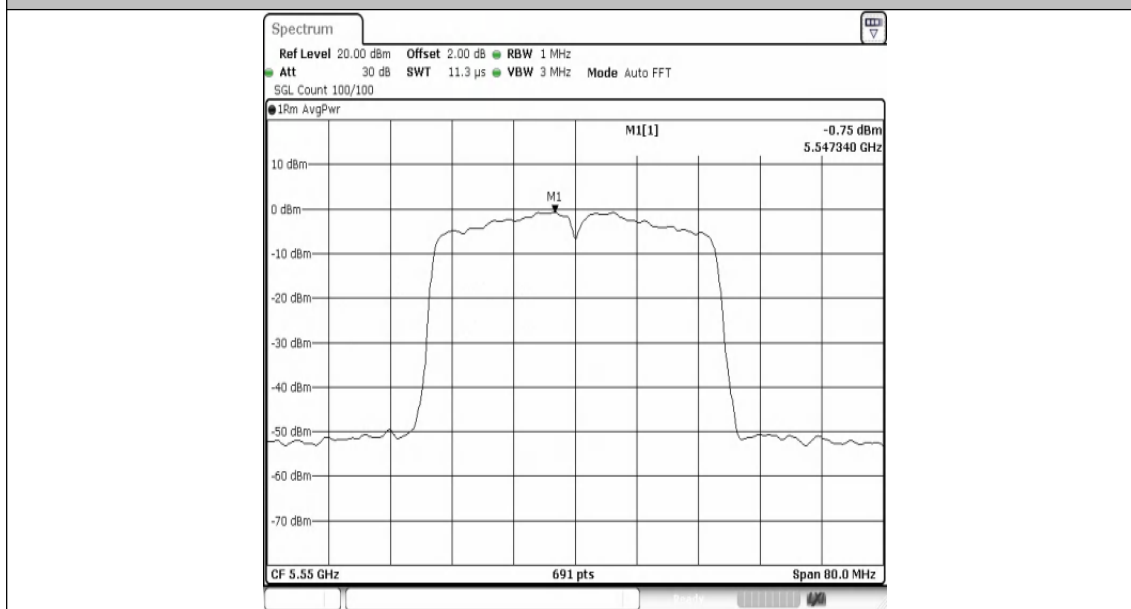


11AC40SISO-Ant1-5550-PASS

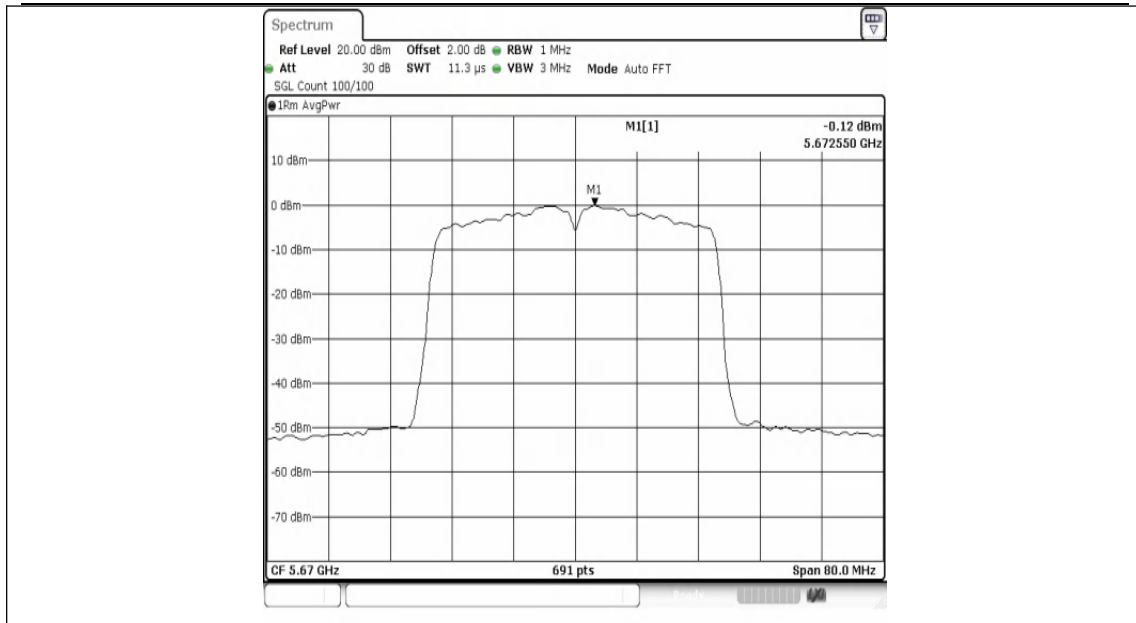


11AC40SISO-Ant1-5670-PASS

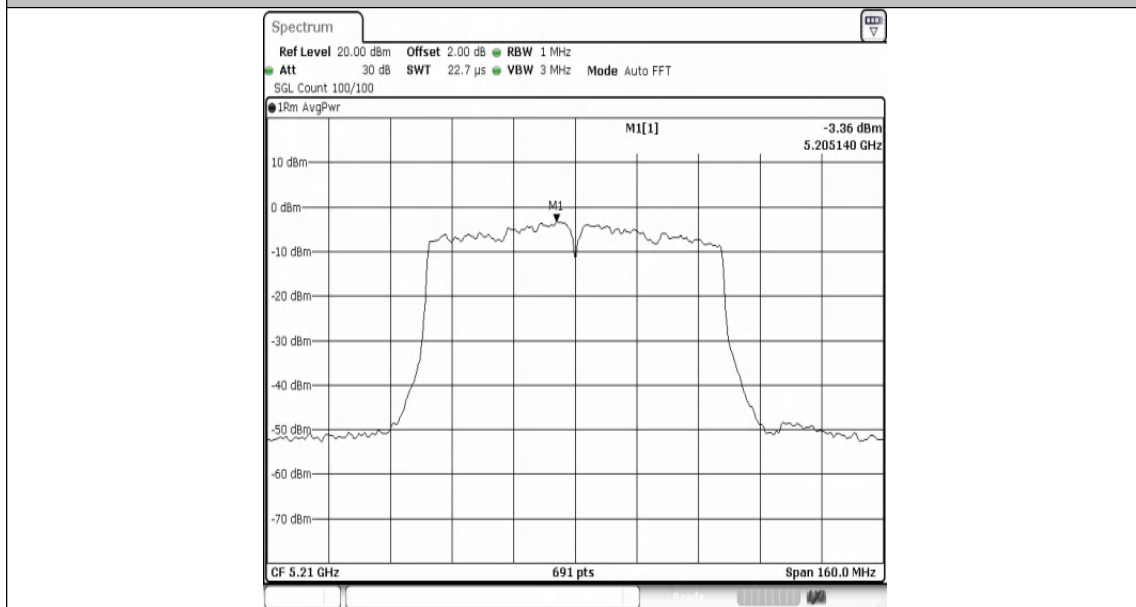


11AC80SISO-Ant1-5210-PASS

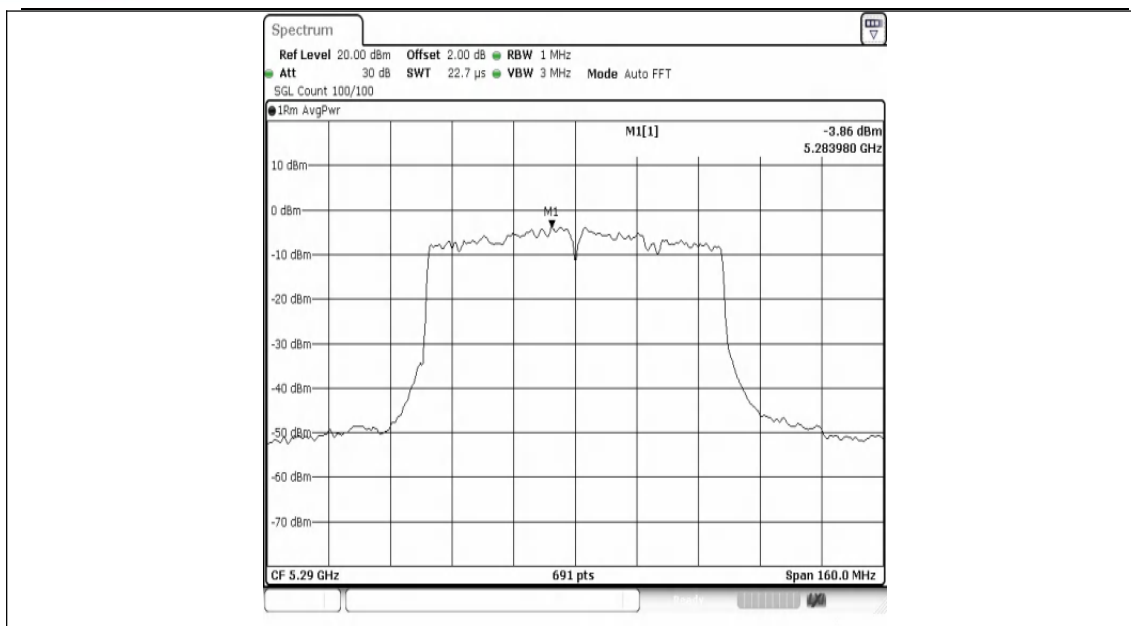

11AC80SISO-Ant1-5290-PASS

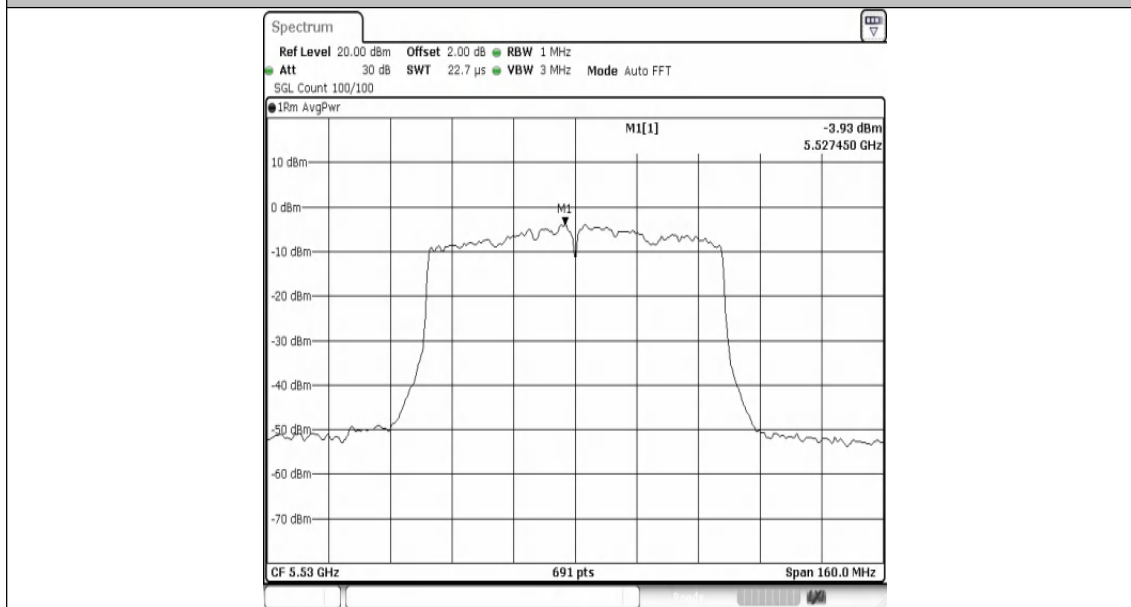


11AC80SISO-Ant1-5530-PASS

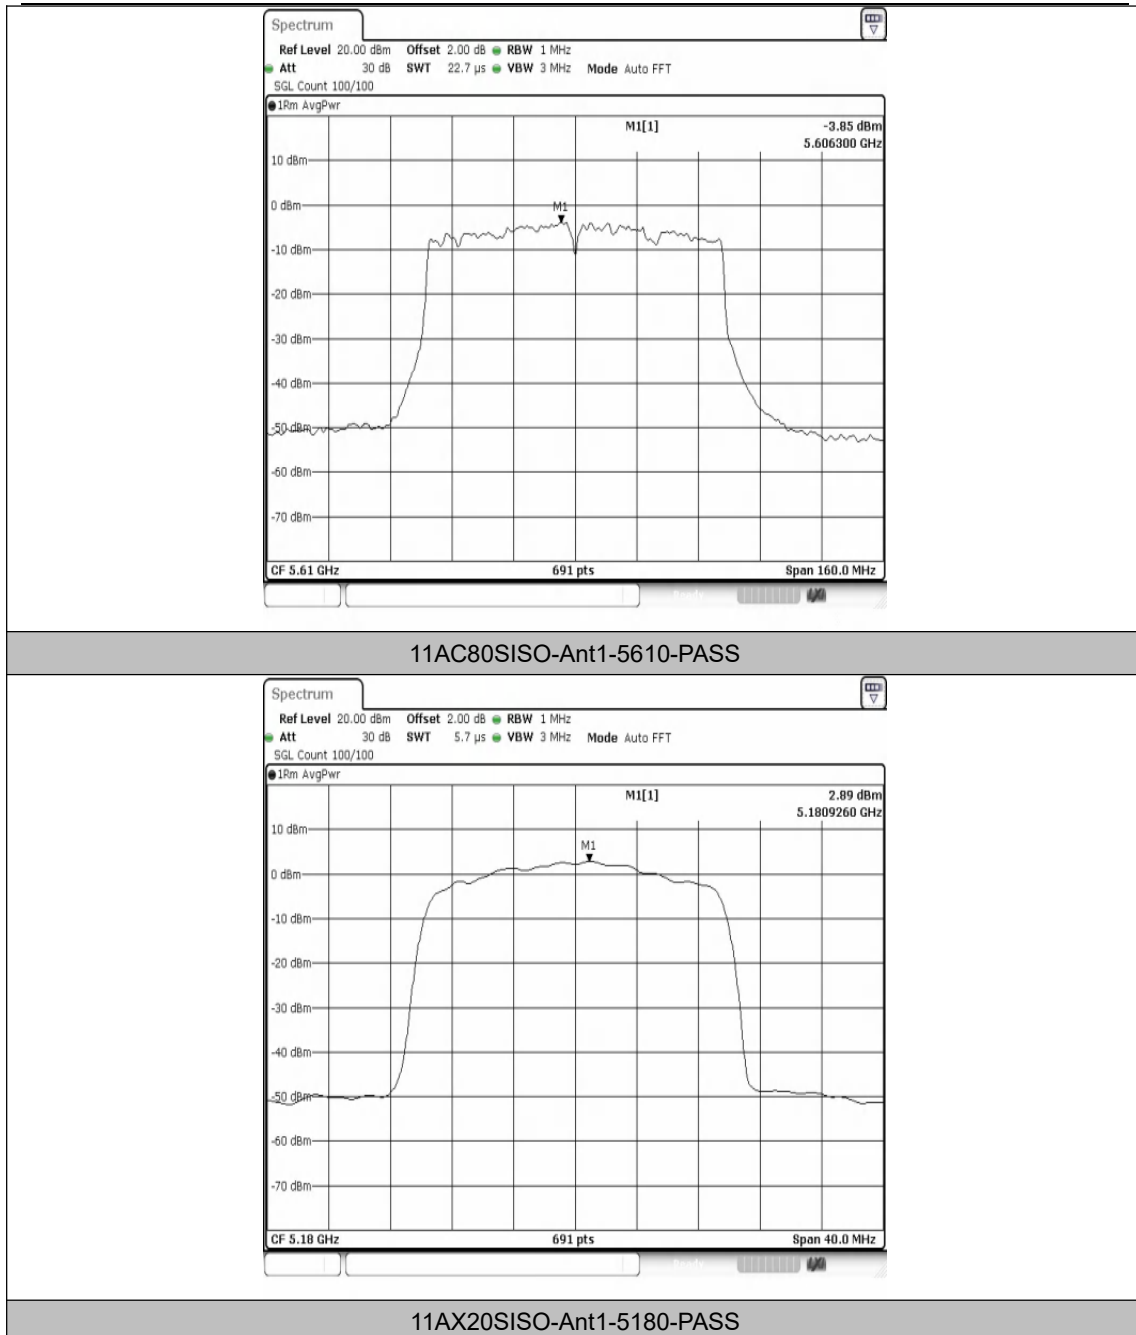


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

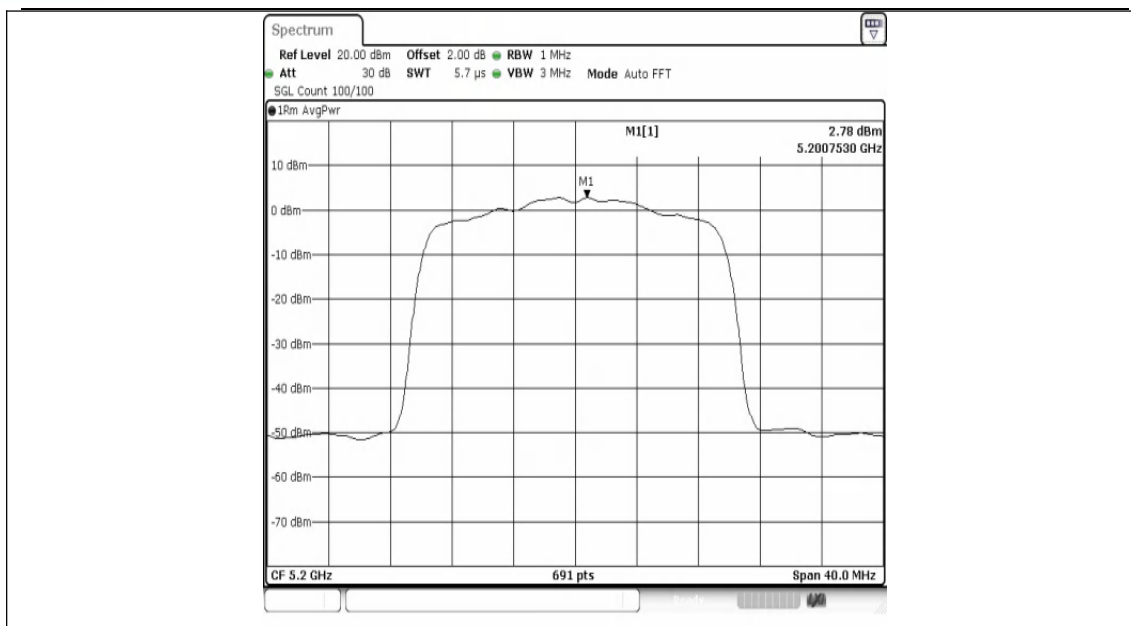


11AX20SISO-Ant1-5200-PASS

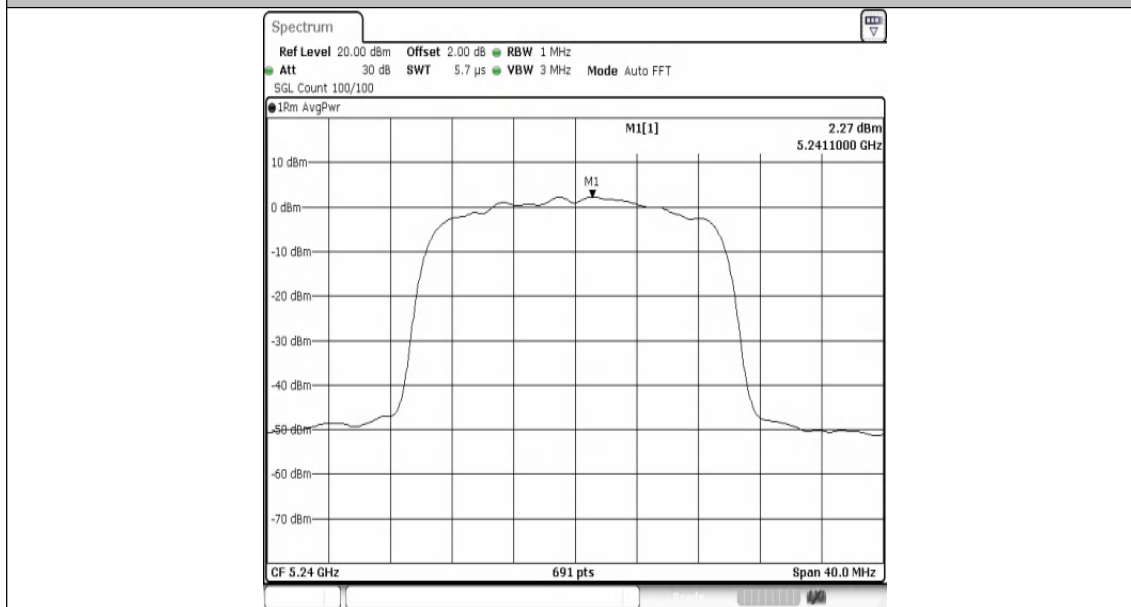


11AX20SISO-Ant1-5240-PASS

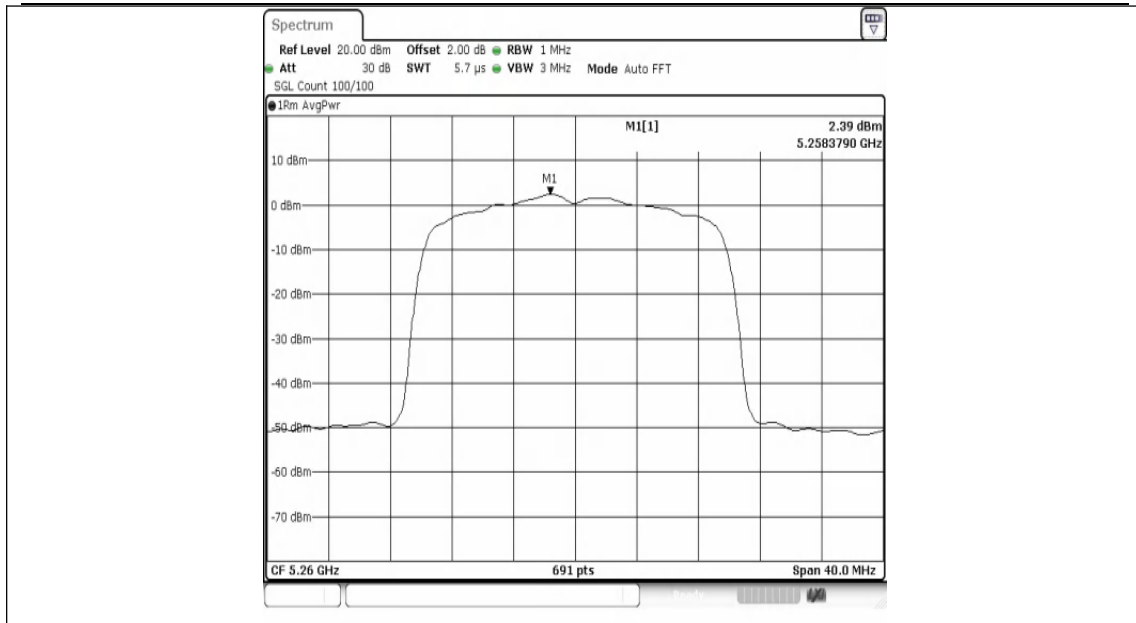


11AX20SISO-Ant1-5260-PASS

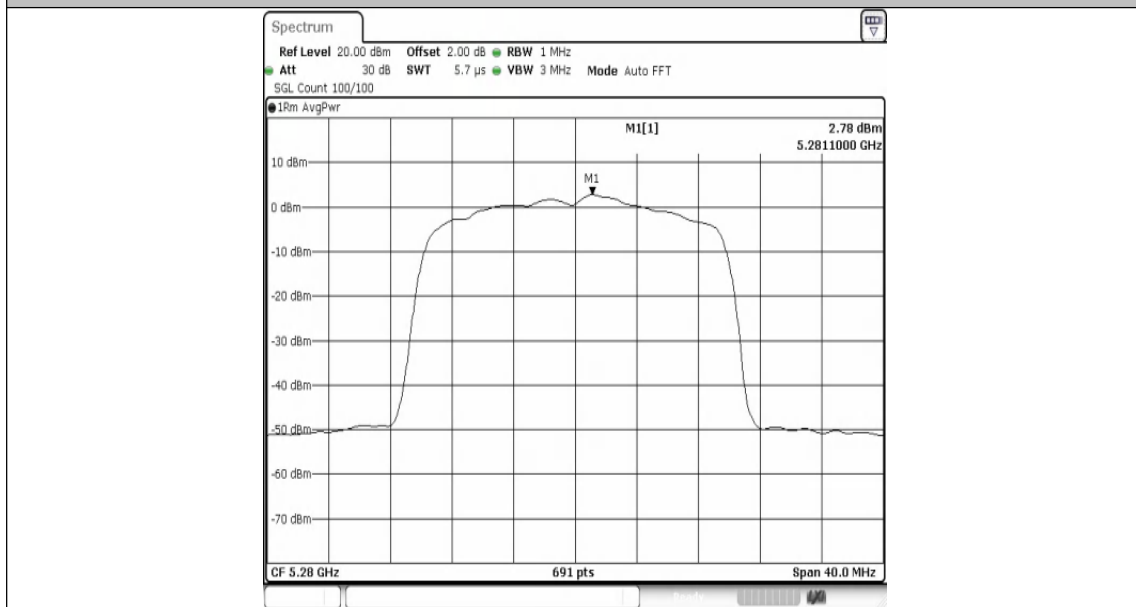


11AX20SISO-Ant1-5280-PASS

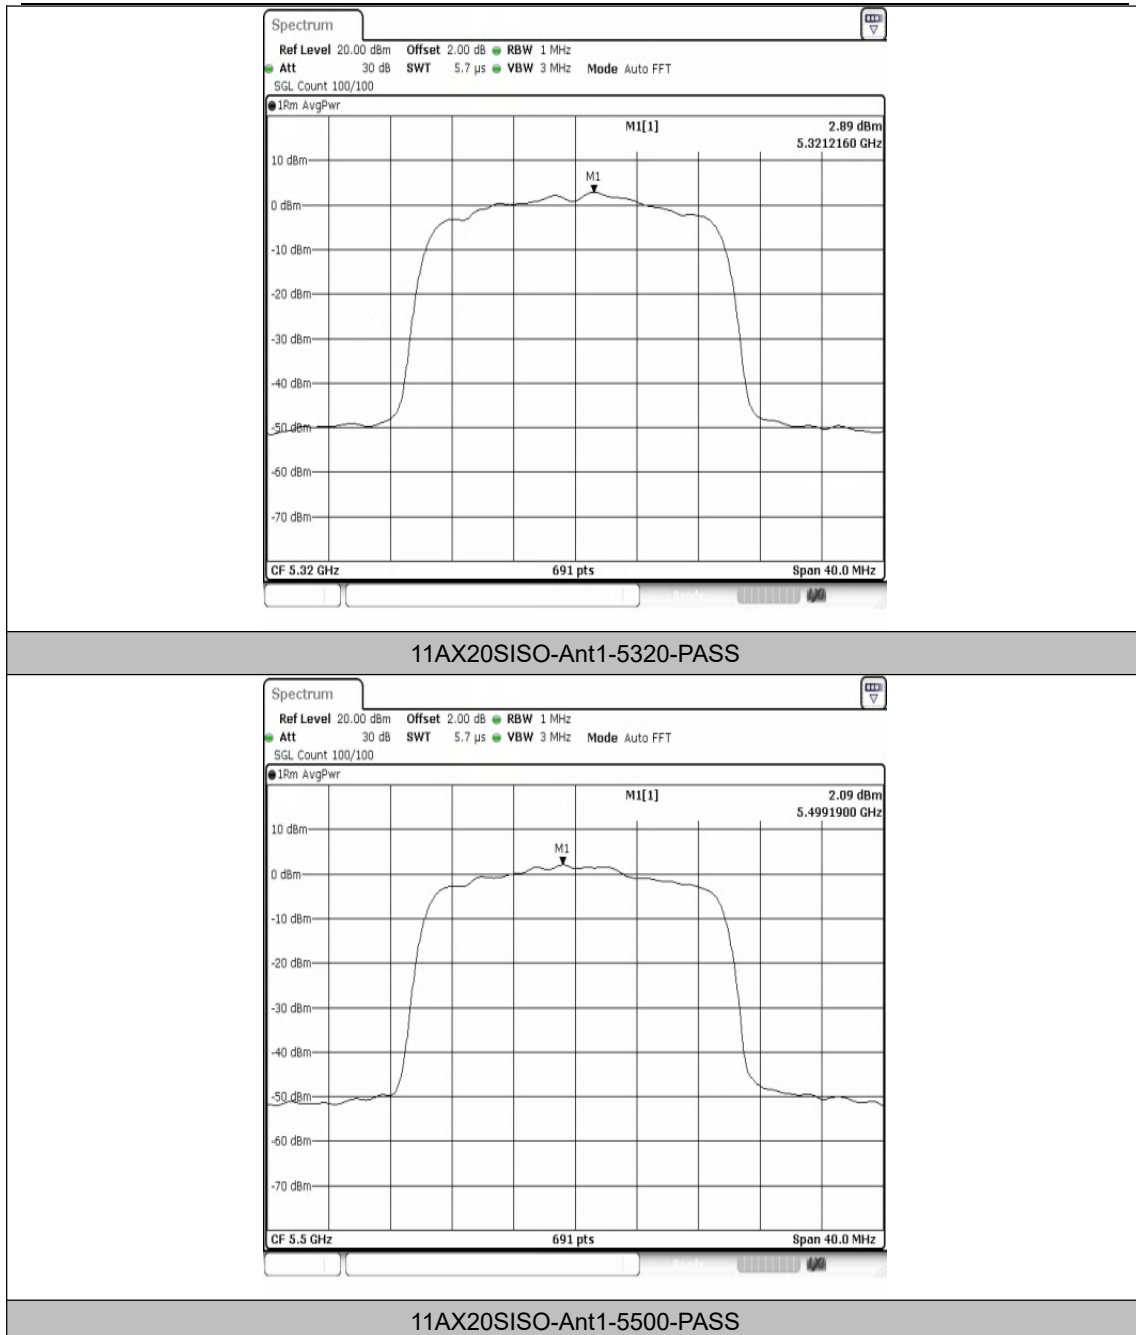


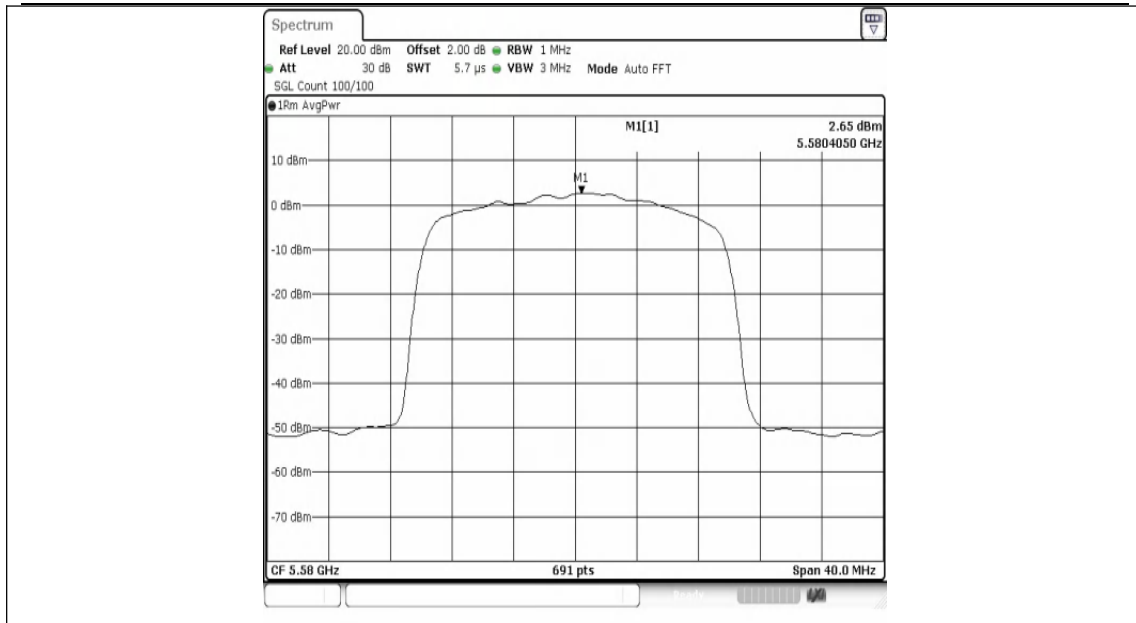

11AX20SISO-Ant1-5580-PASS

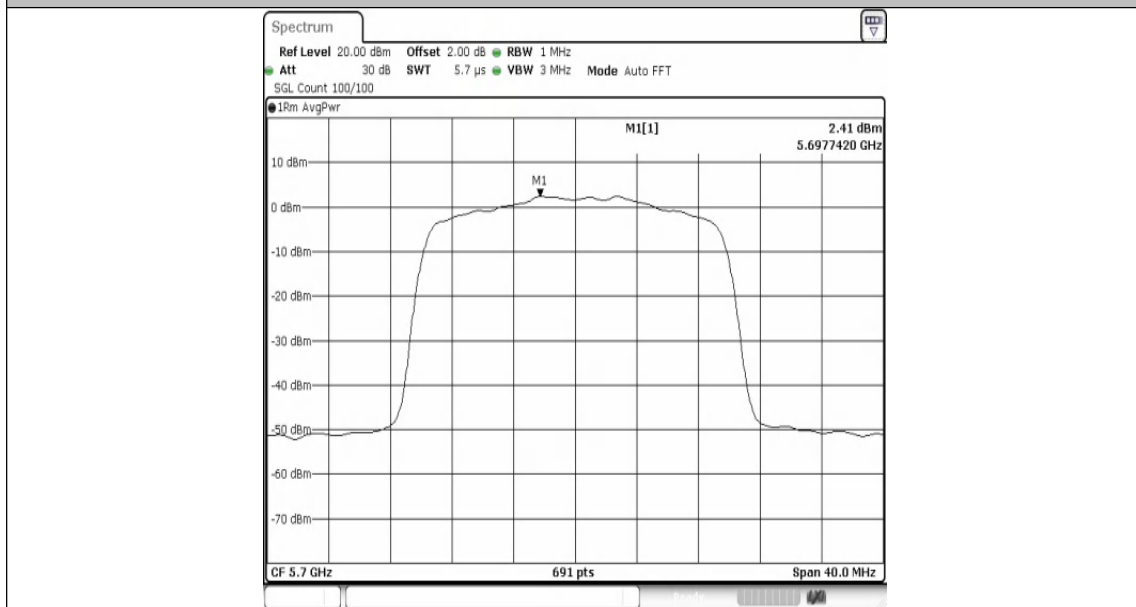


11AX20SISO-Ant1-5700-PASS

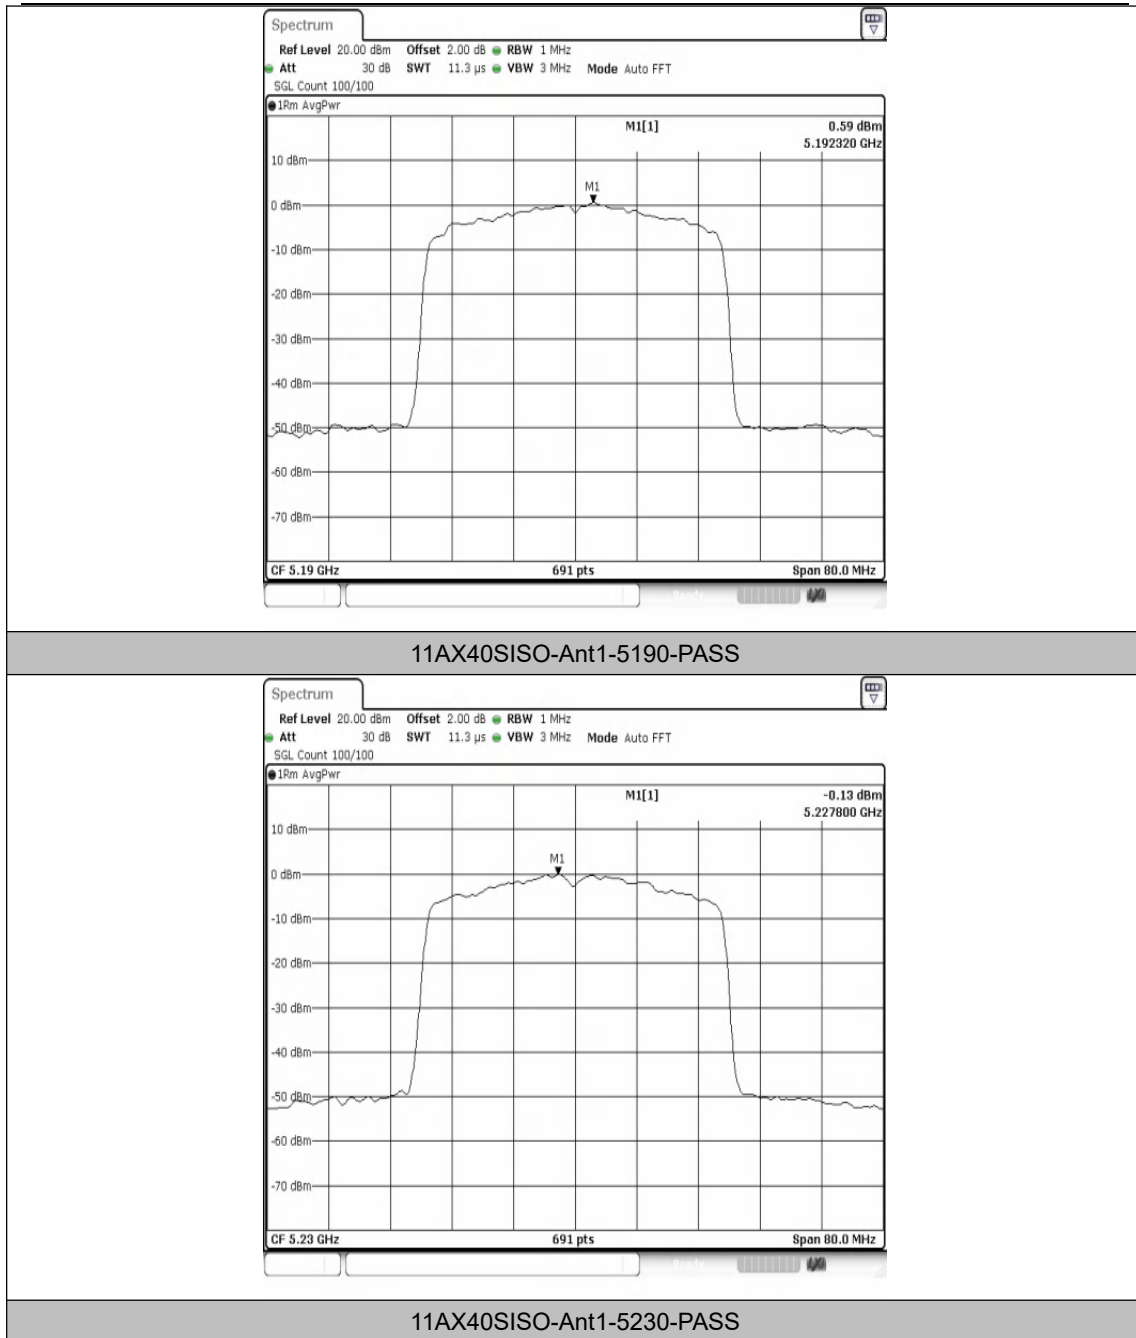


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

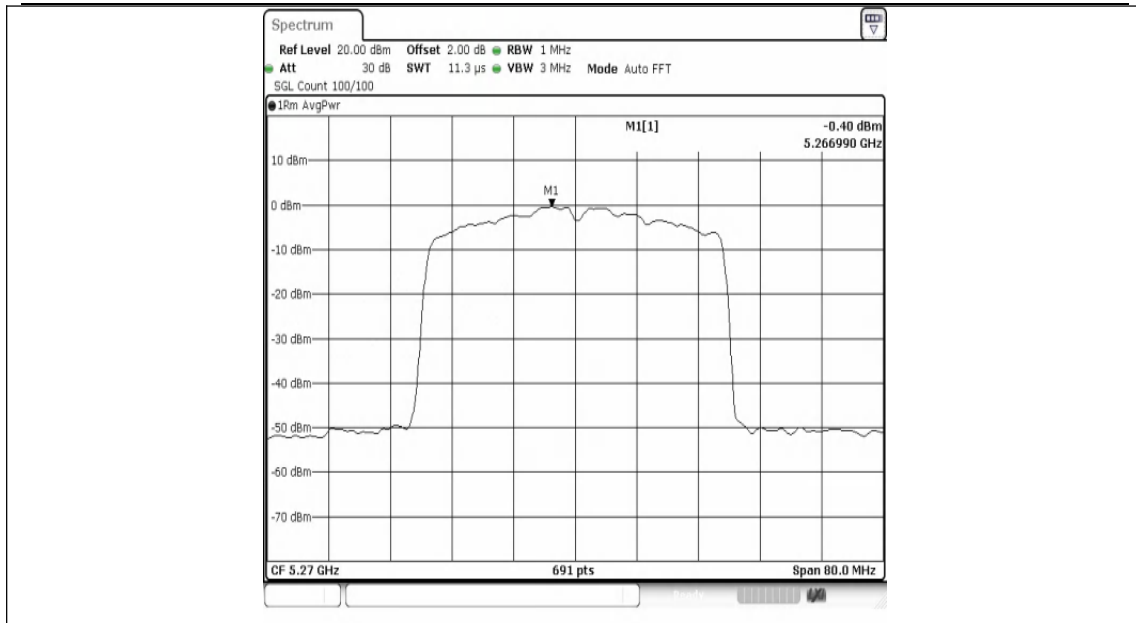


11AX40SISO-Ant1-5270-PASS

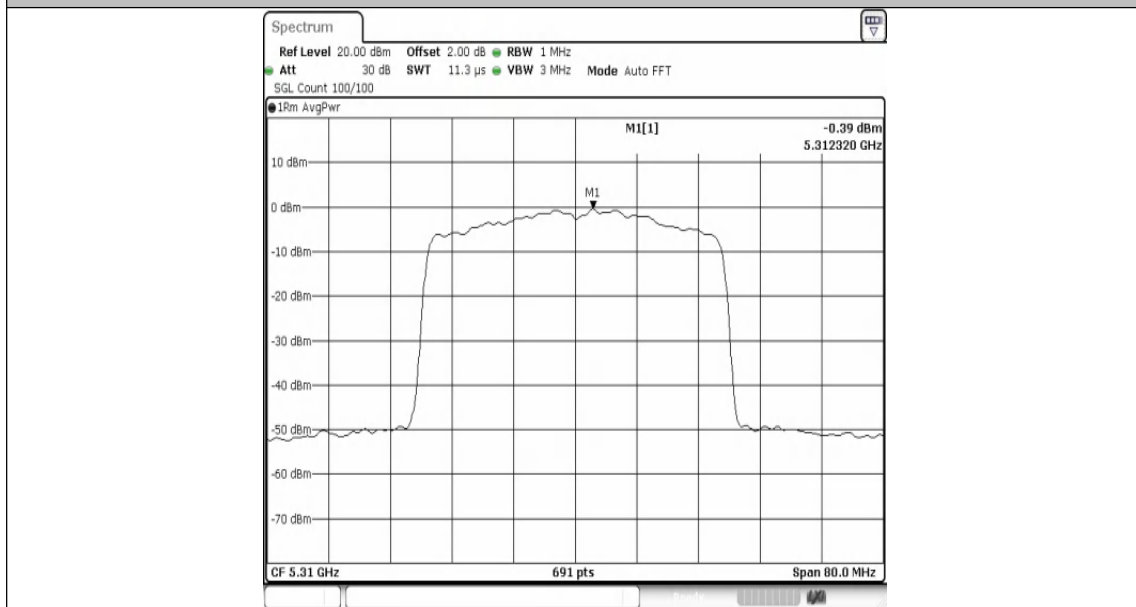


11AX40SISO-Ant1-5310-PASS

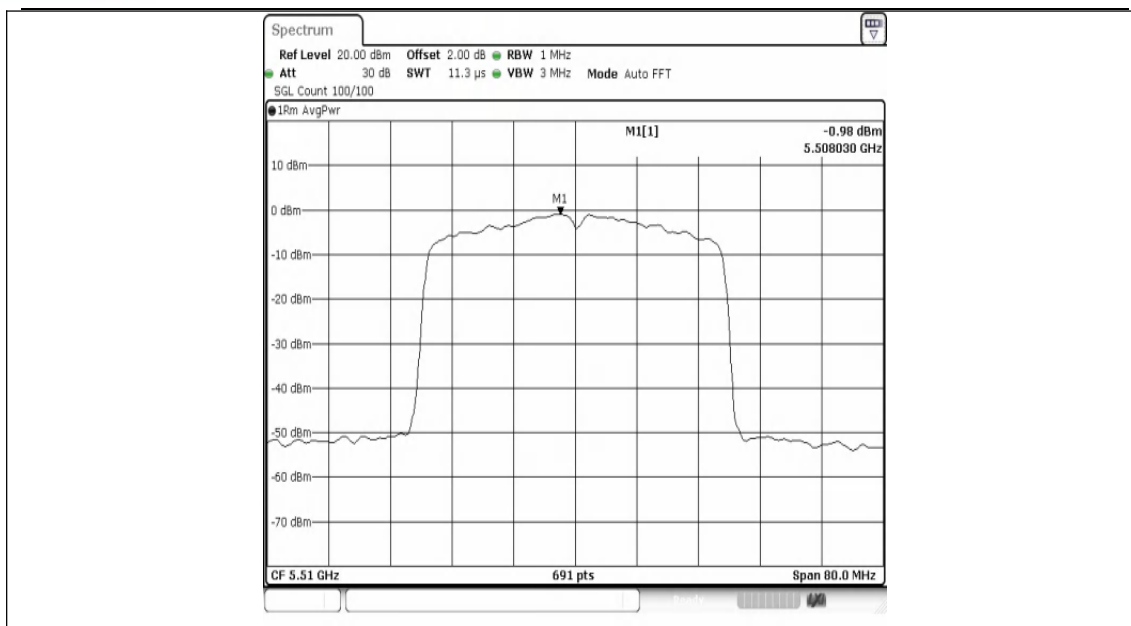


11AX40SISO-Ant1-5510-PASS

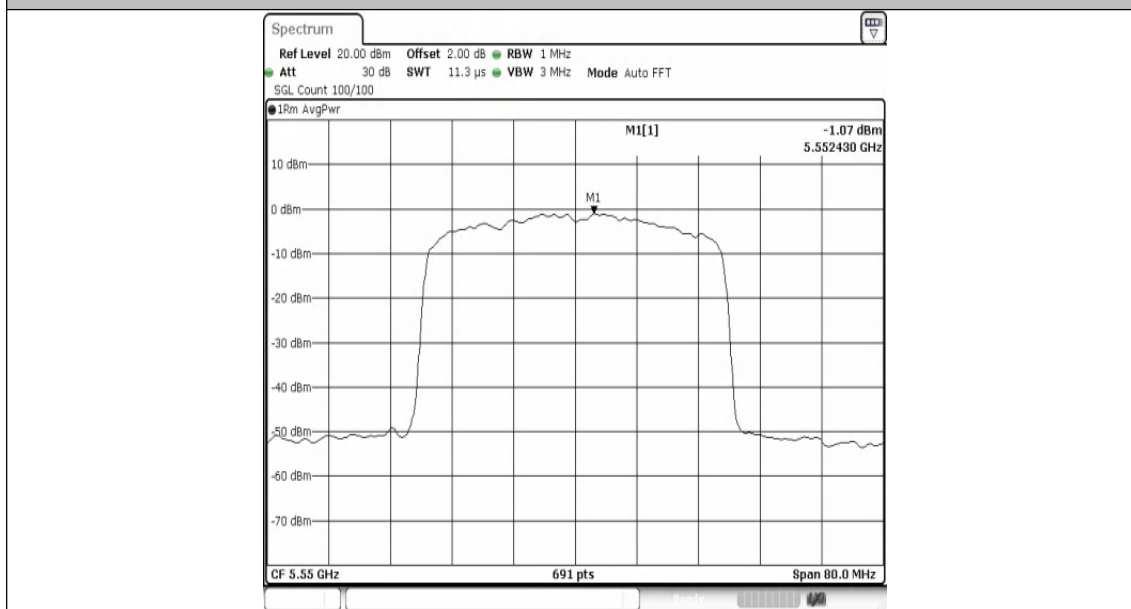


11AX40SISO-Ant1-5550-PASS

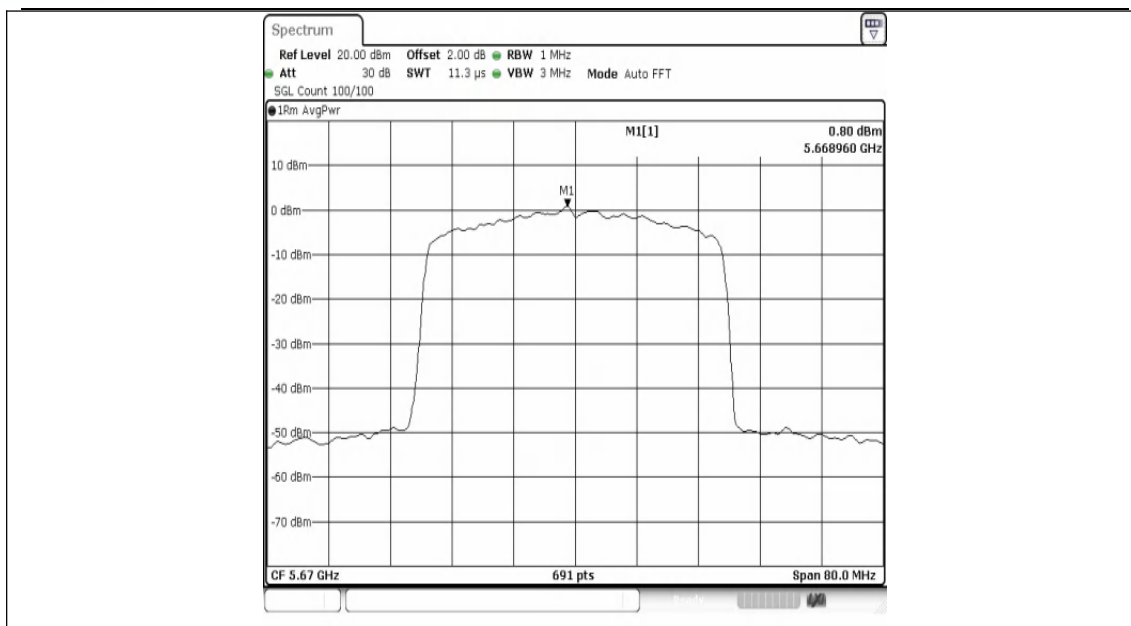


11AX40SISO-Ant1-5670-PASS

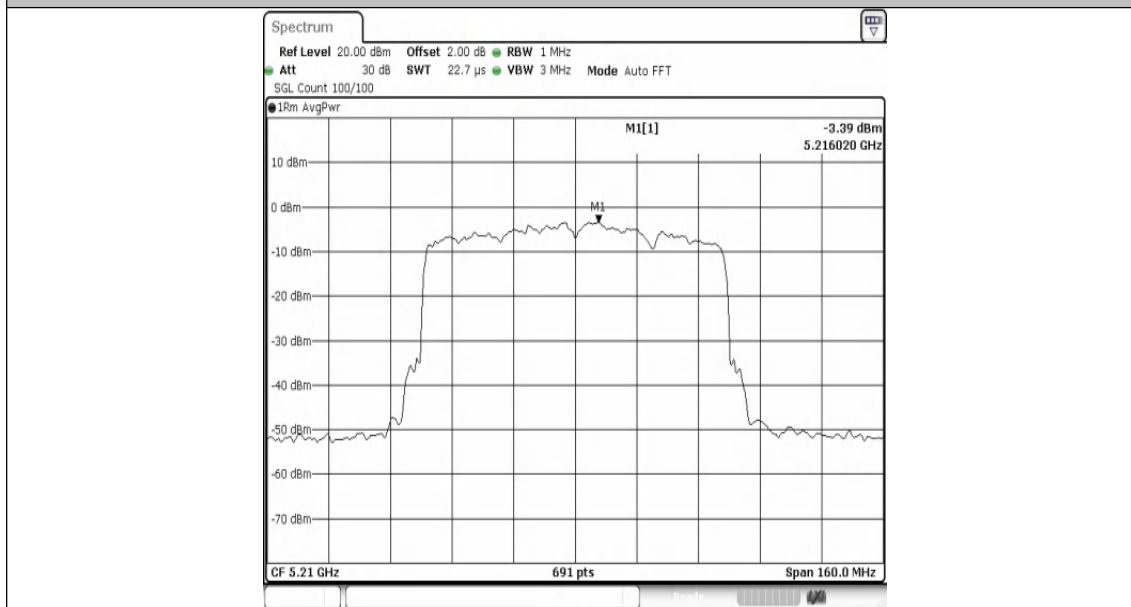


11AX80SISO-Ant1-5210-PASS

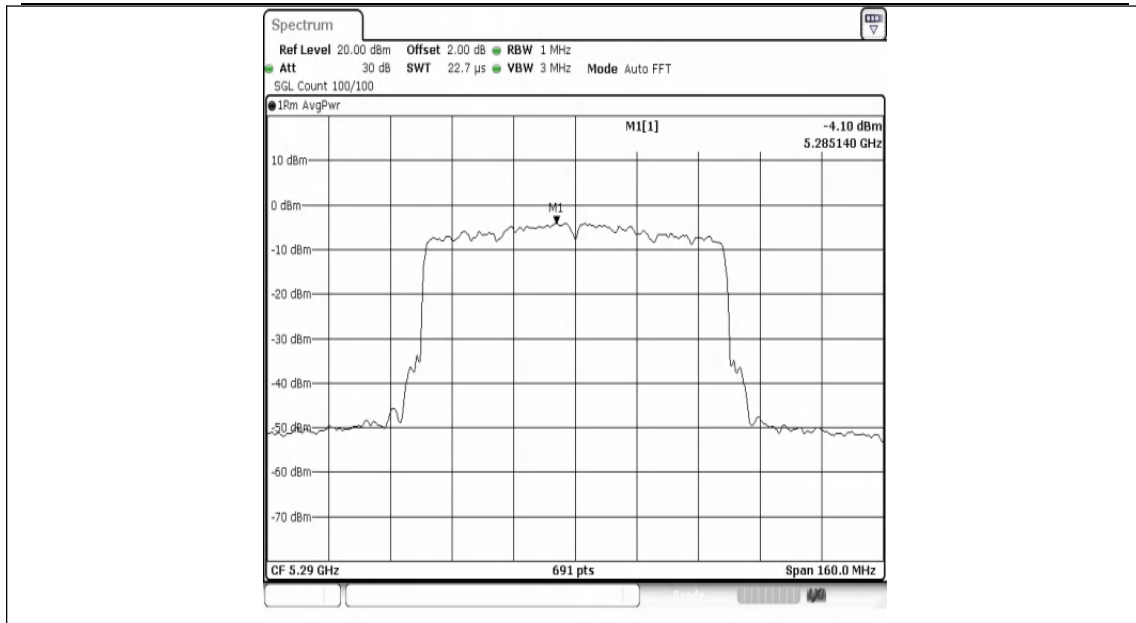

11AX80SISO-Ant1-5290-PASS

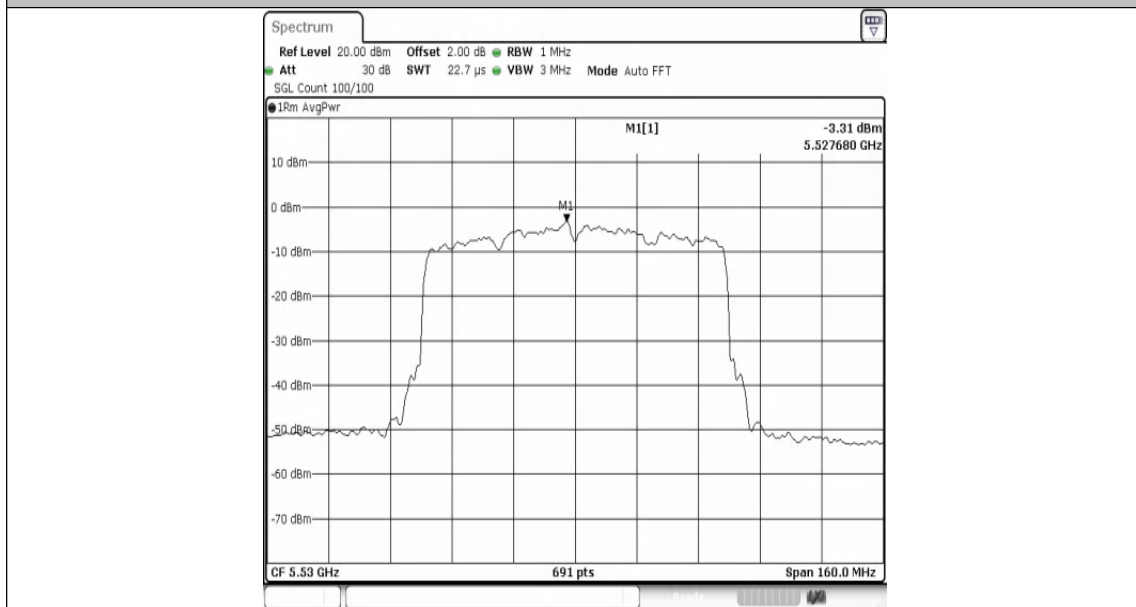

11AX80SISO-Ant1-5530-PASS

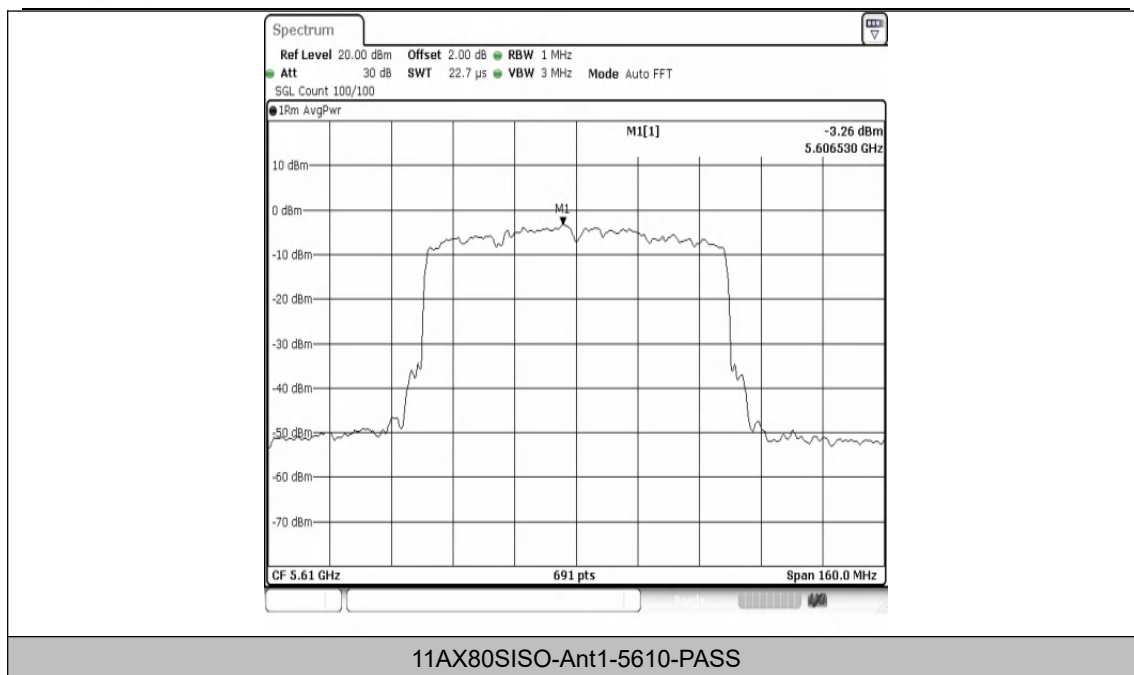


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs B4

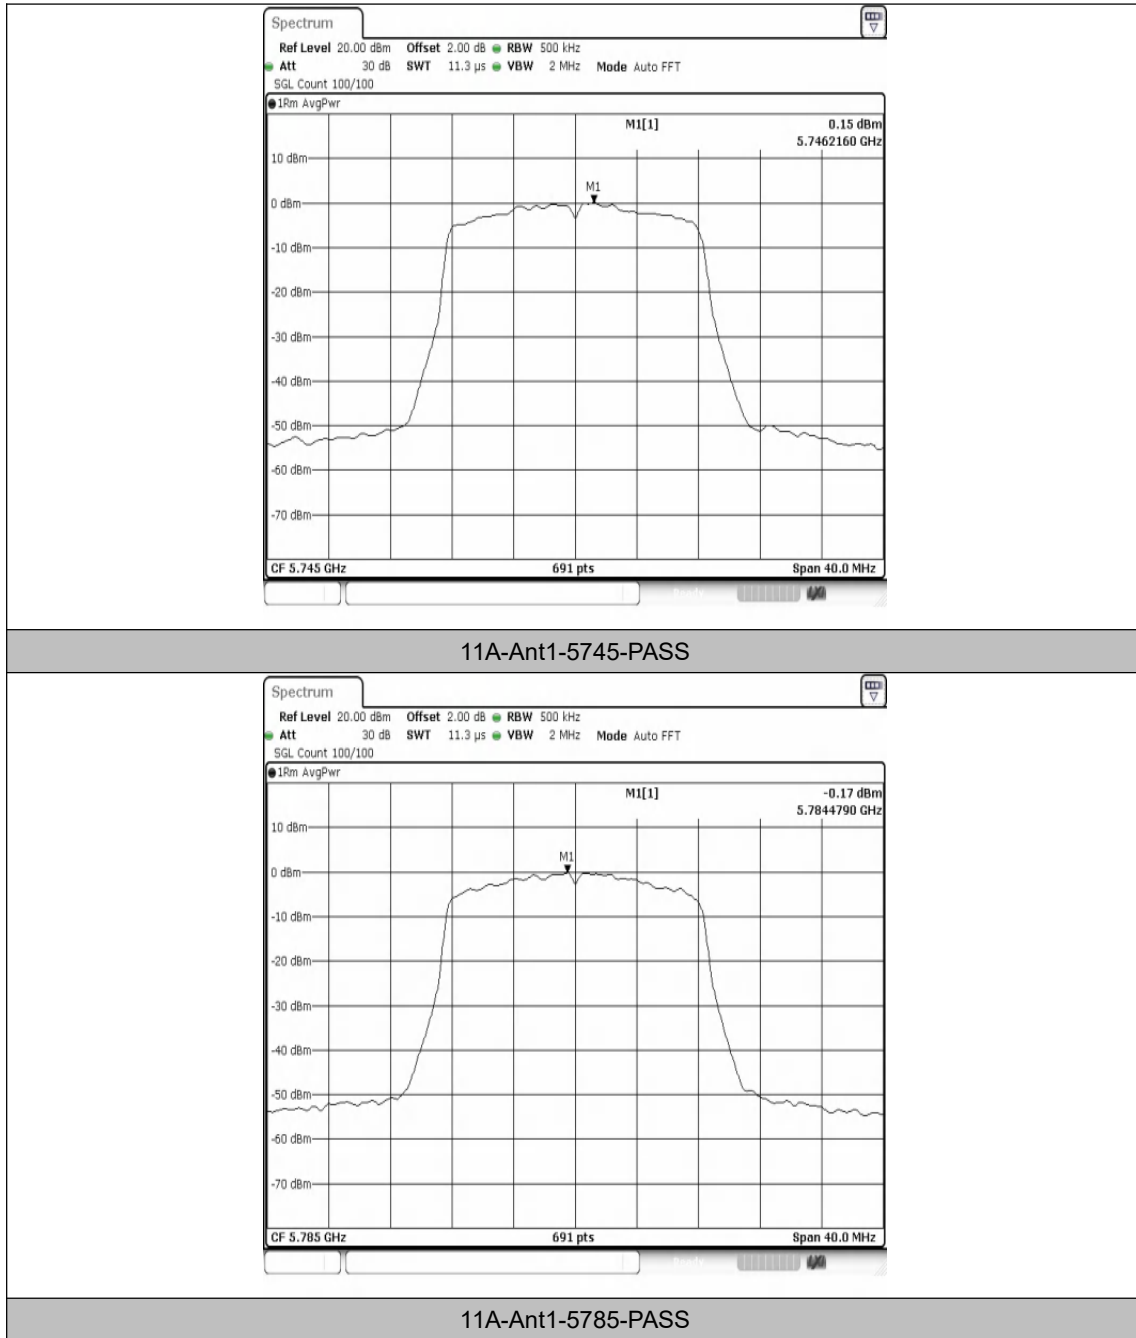

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

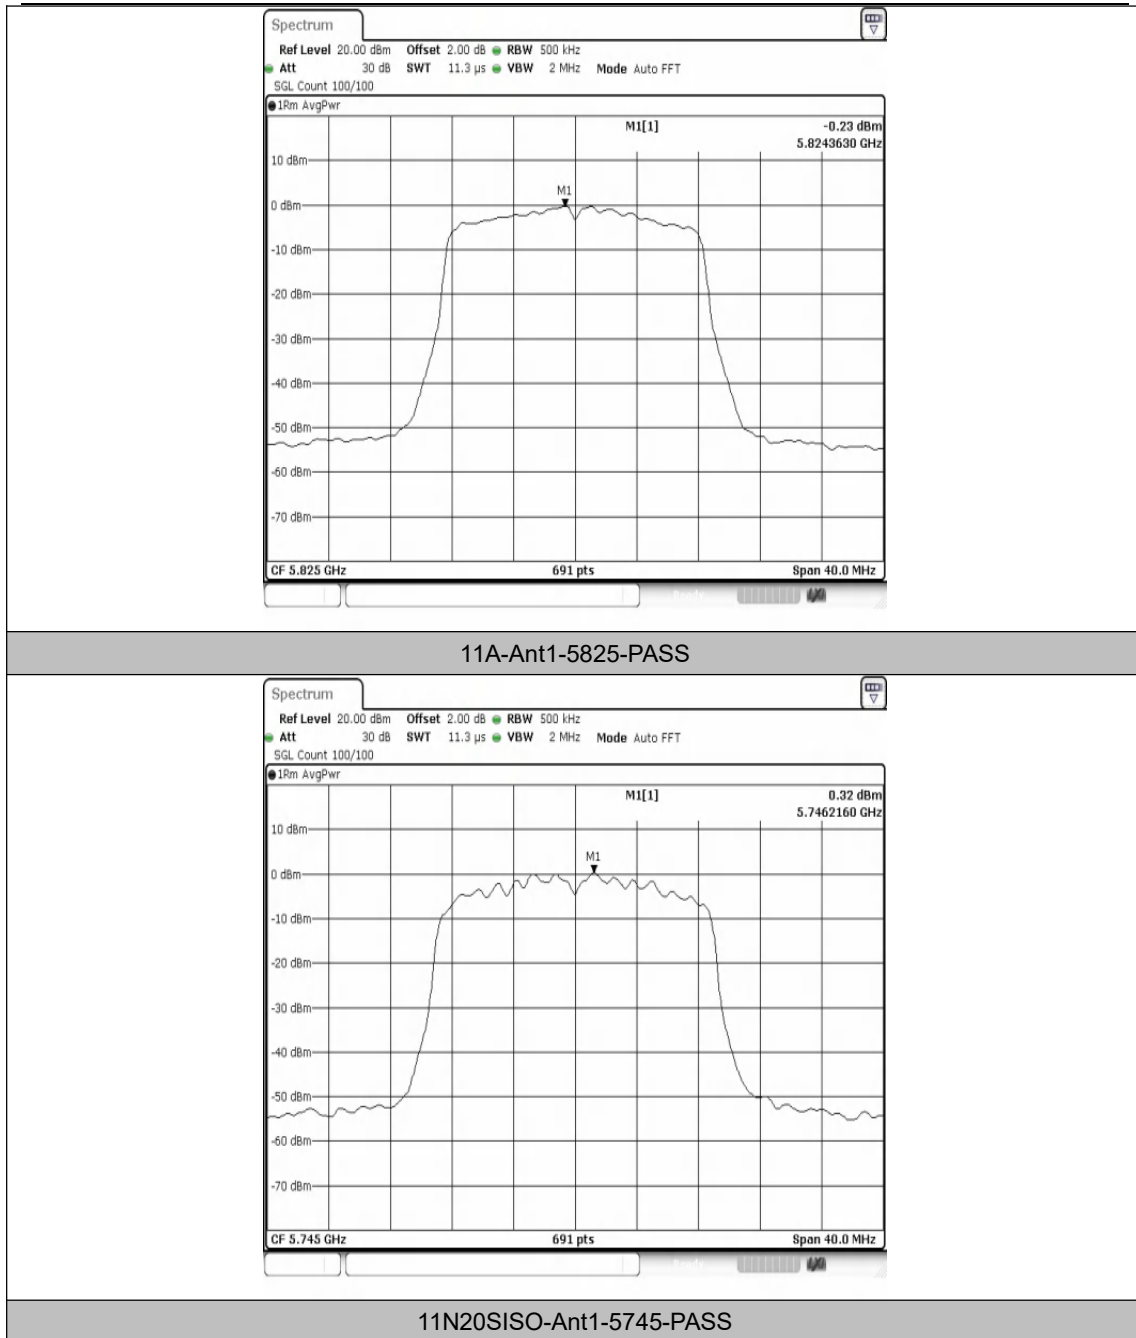

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

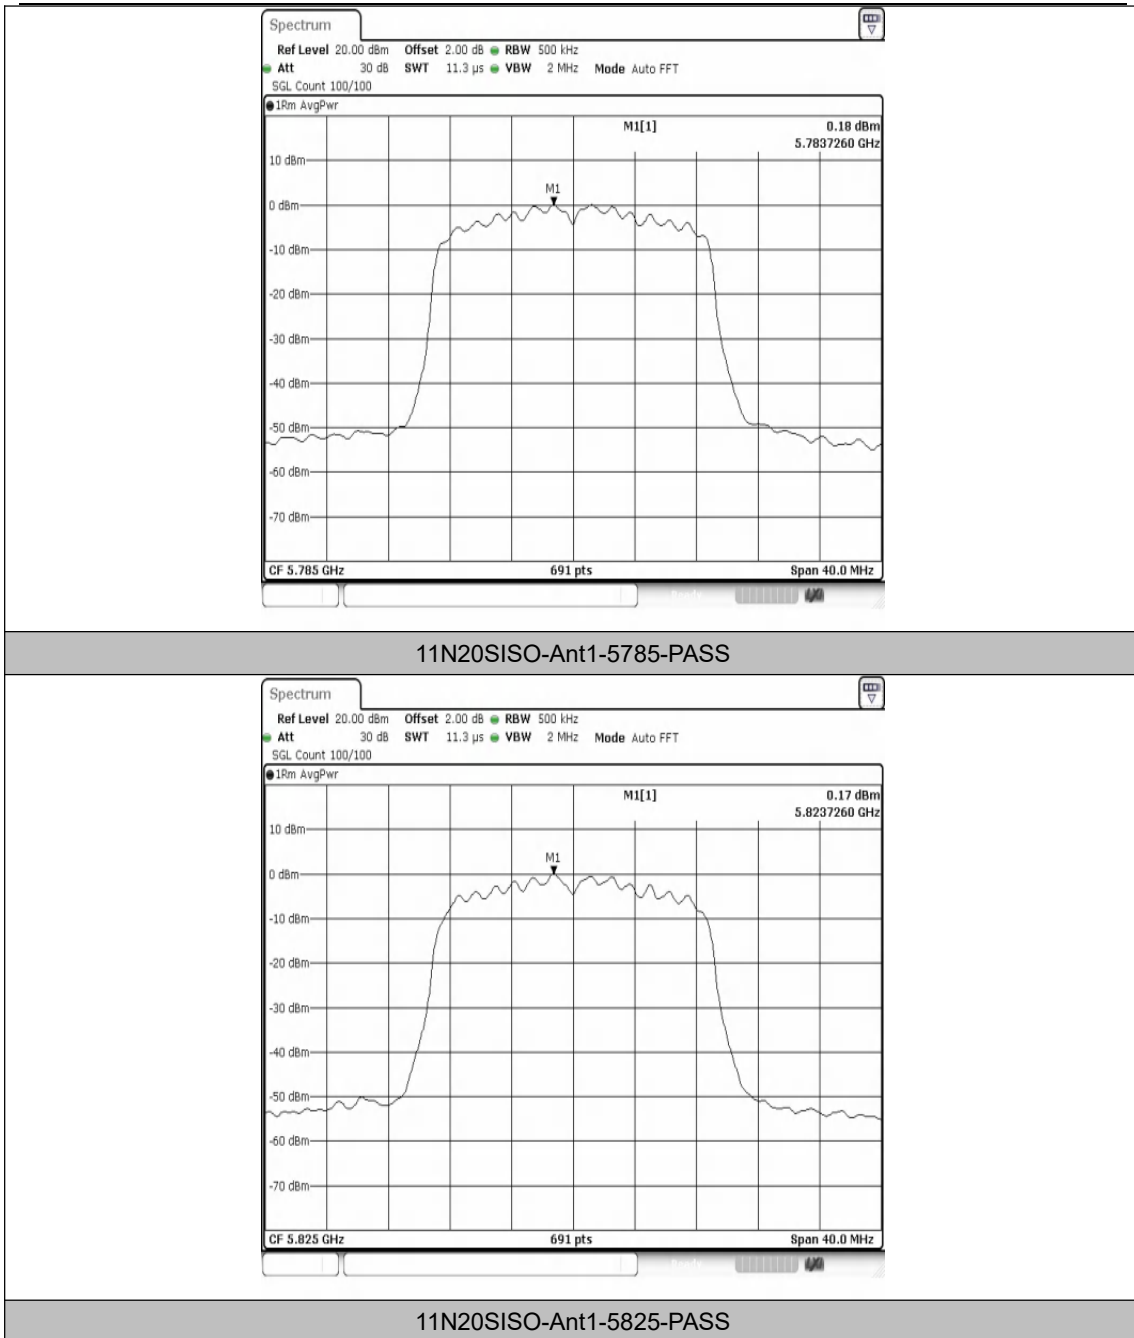


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

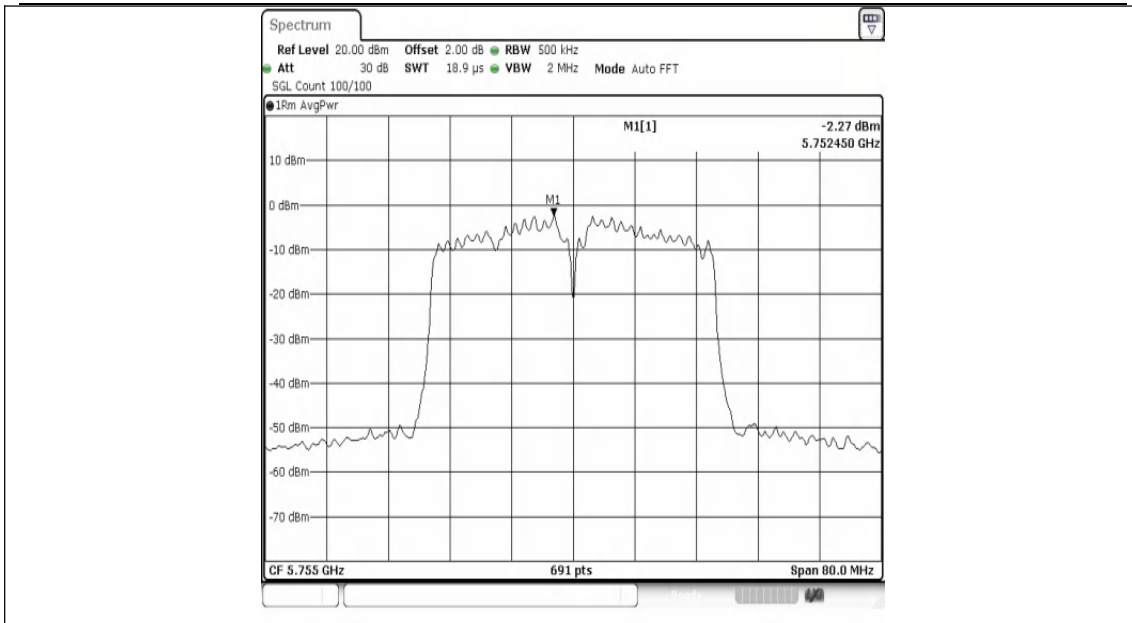


11N40SISO-Ant1-5755-PASS

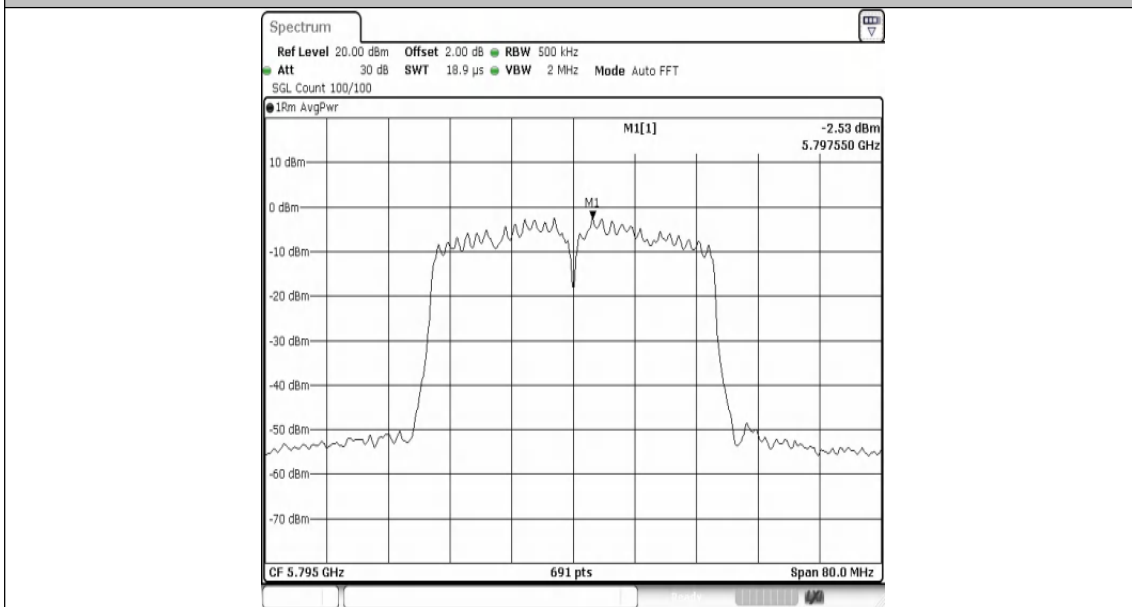


11N40SISO-Ant1-5795-PASS

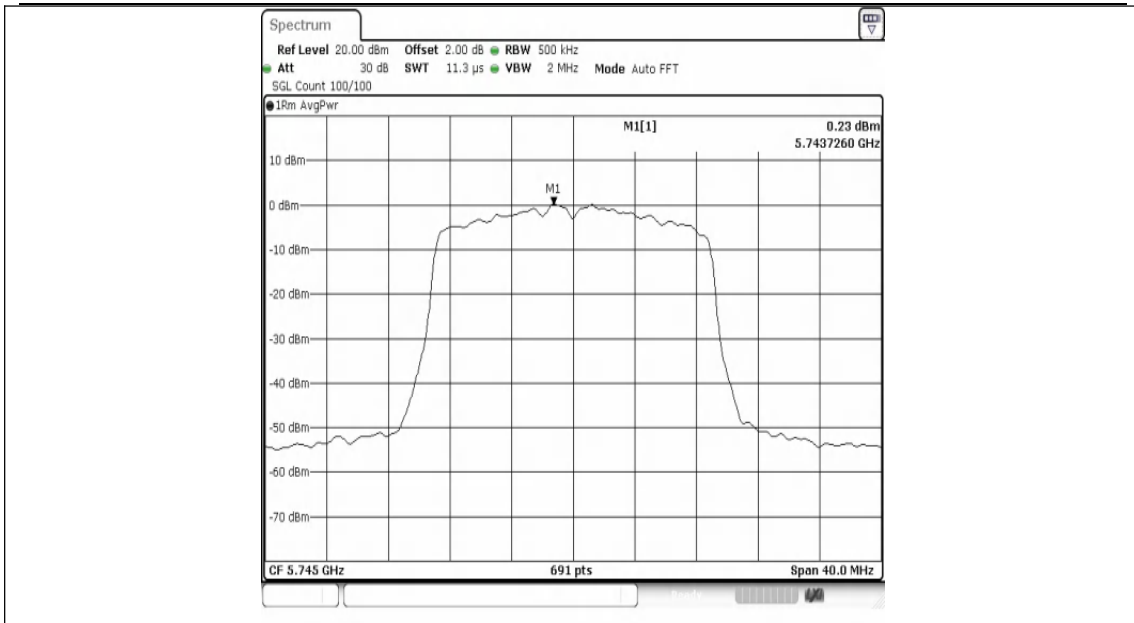


11AC20SISO-Ant1-5745-PASS

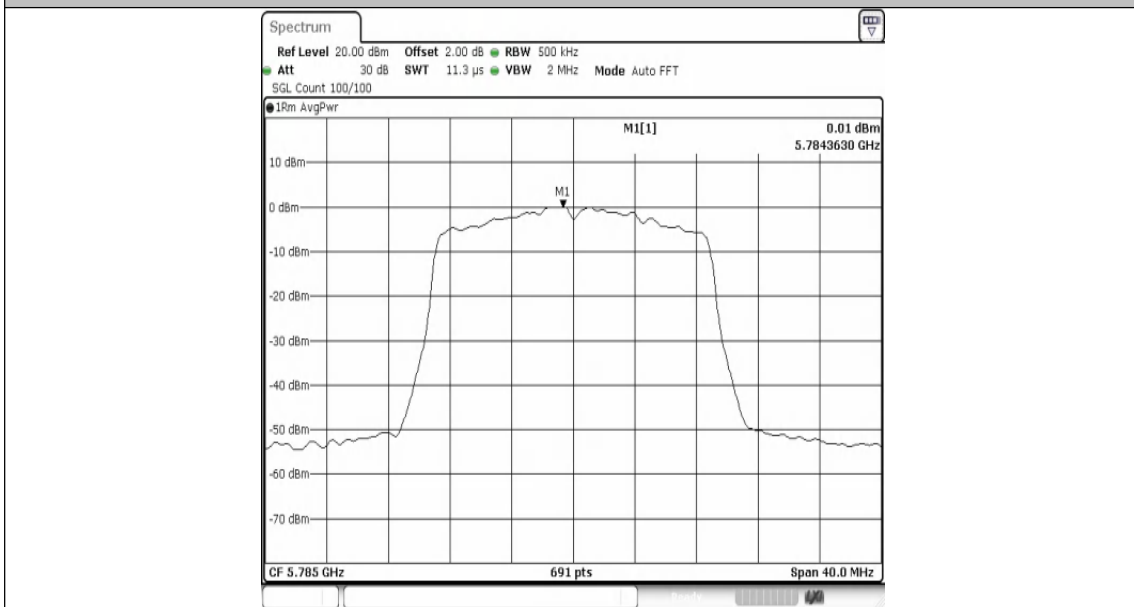


11AC20SISO-Ant1-5785-PASS

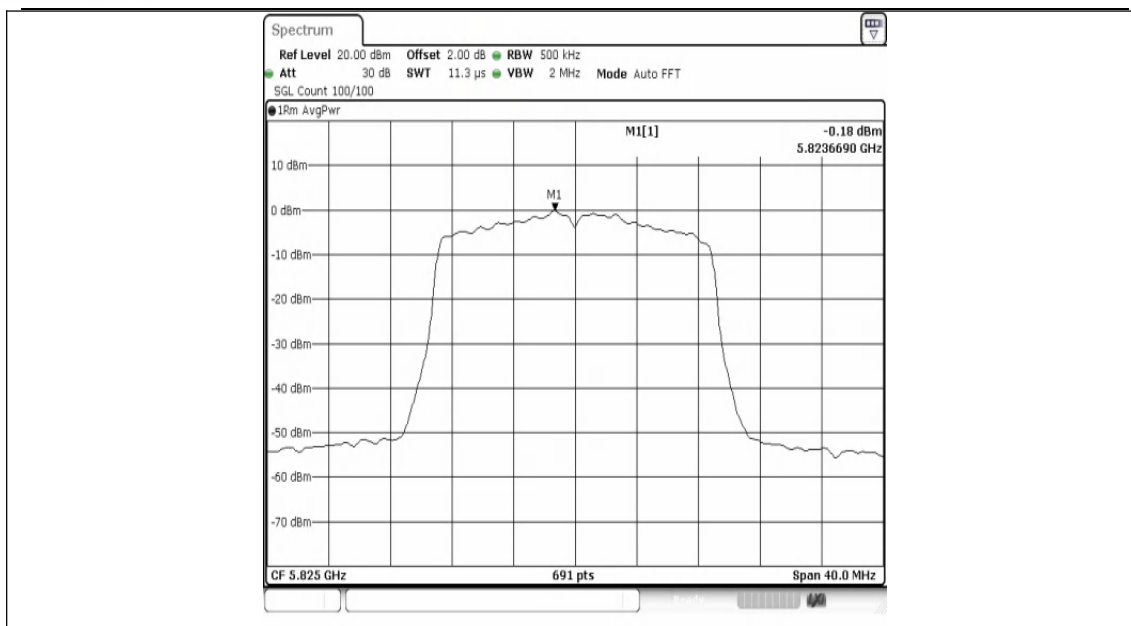


11AC20SISO-Ant1-5825-PASS

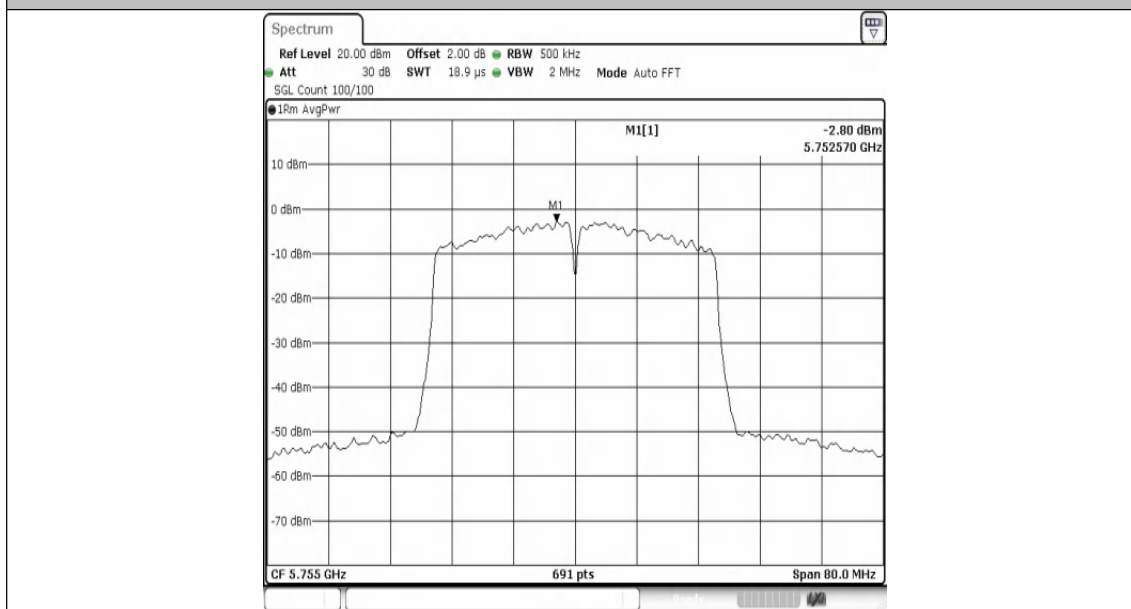


11AC40SISO-Ant1-5755-PASS

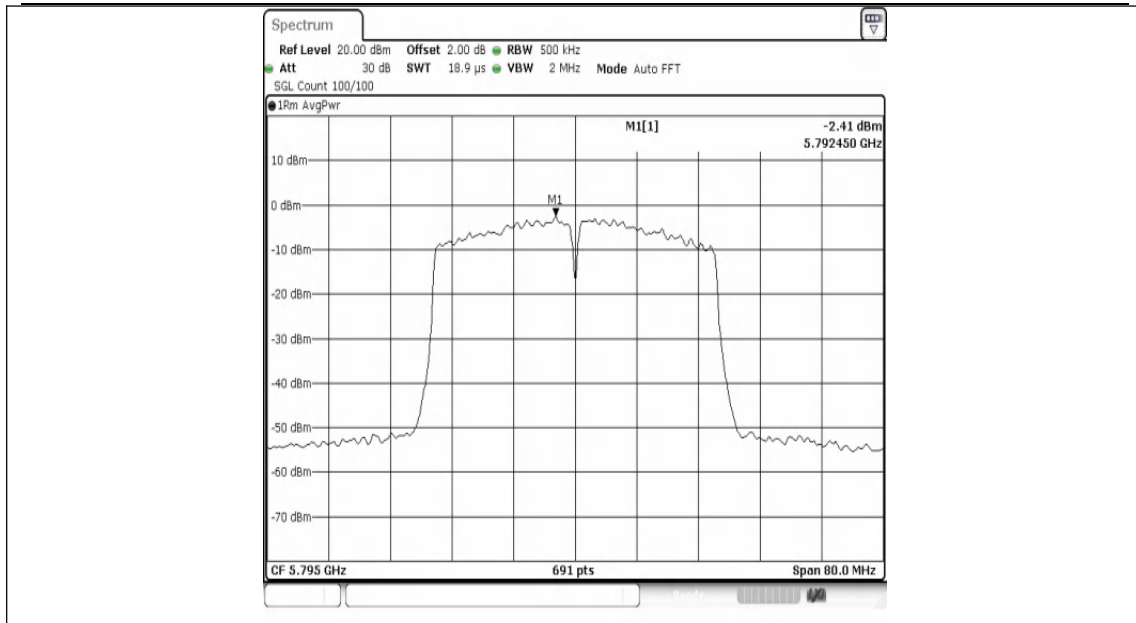


11AC40SISO-Ant1-5795-PASS

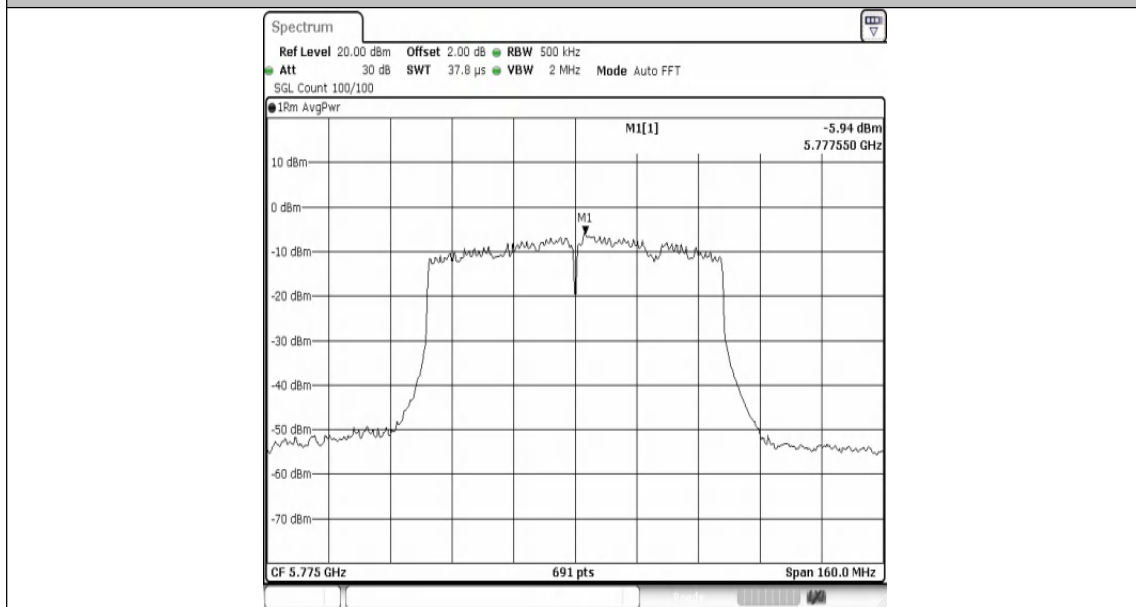


11AC80SISO-Ant1-5775-PASS

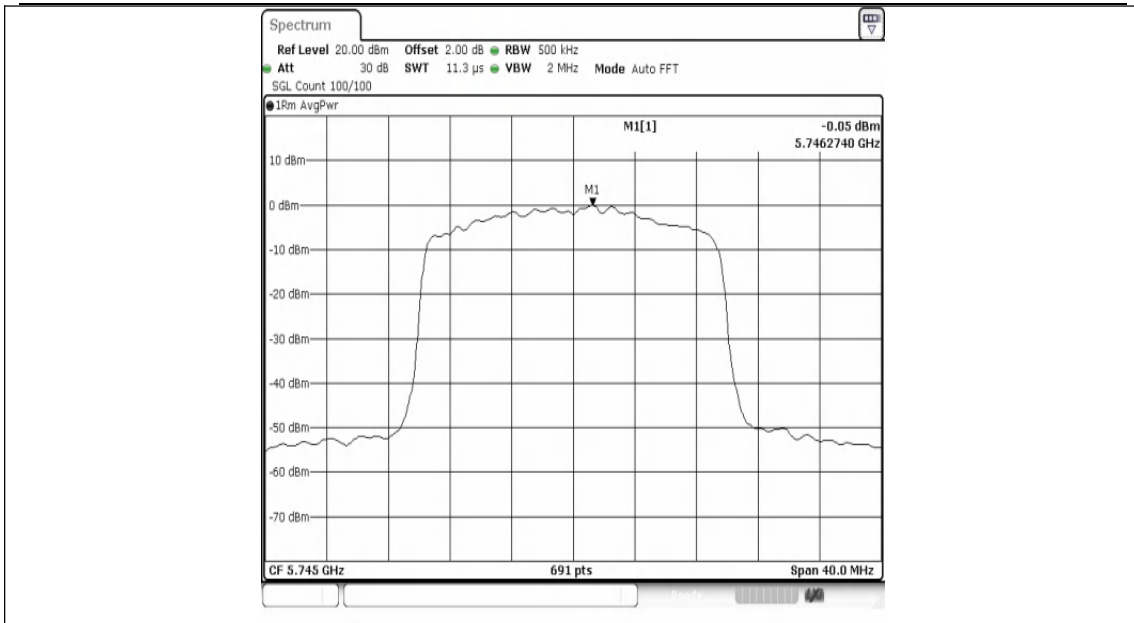

11AX20SISO-Ant1-5745-PASS

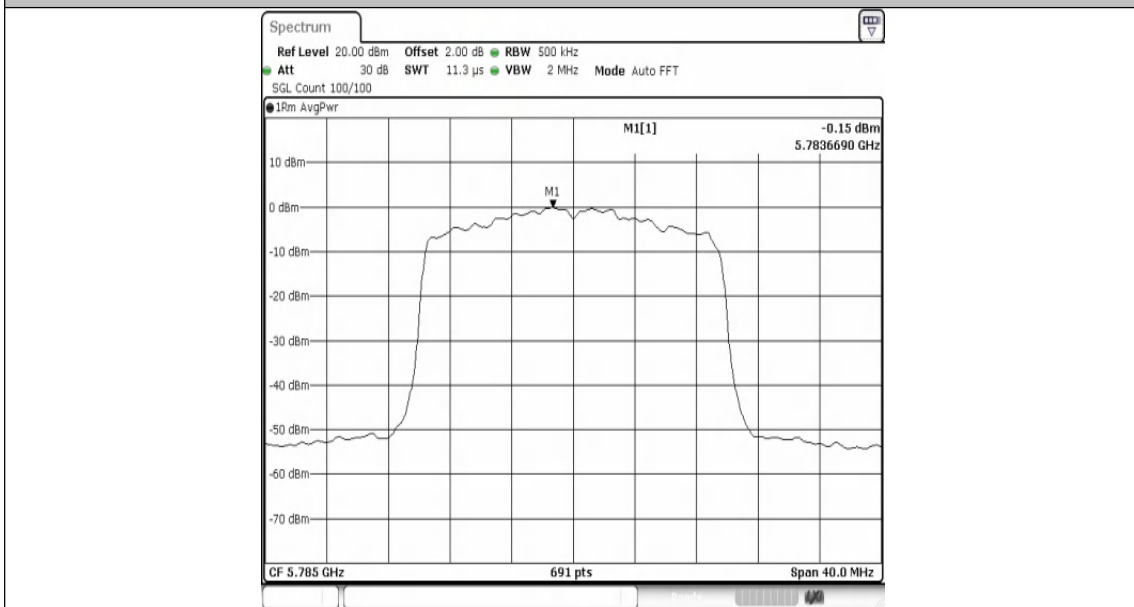


11AX20SISO-Ant1-5785-PASS

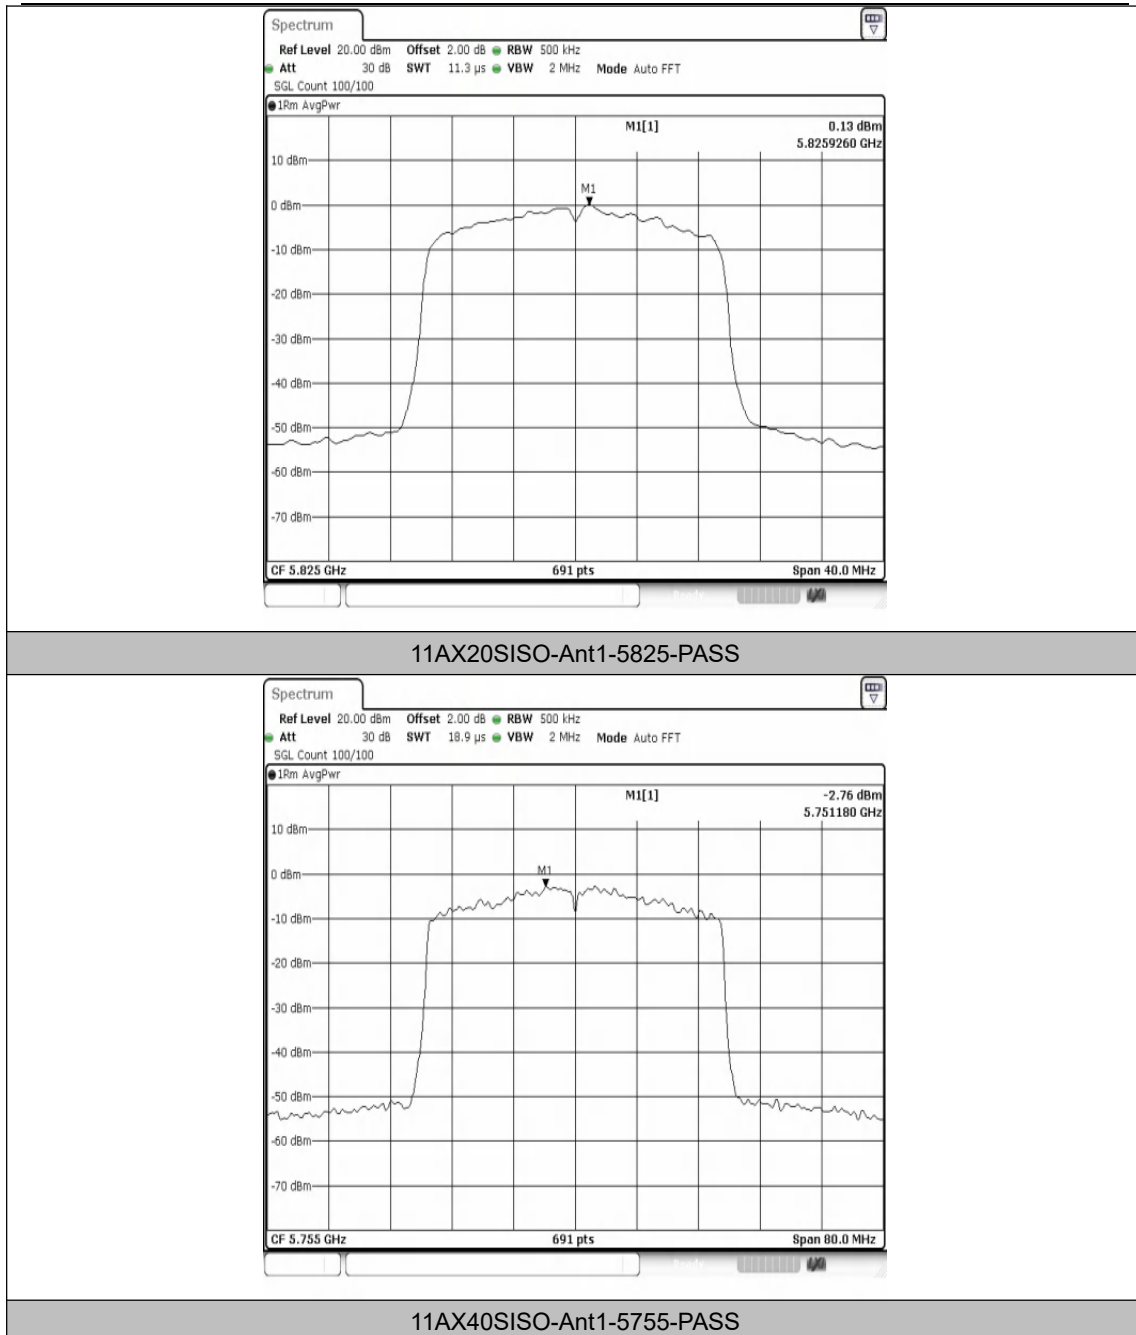

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

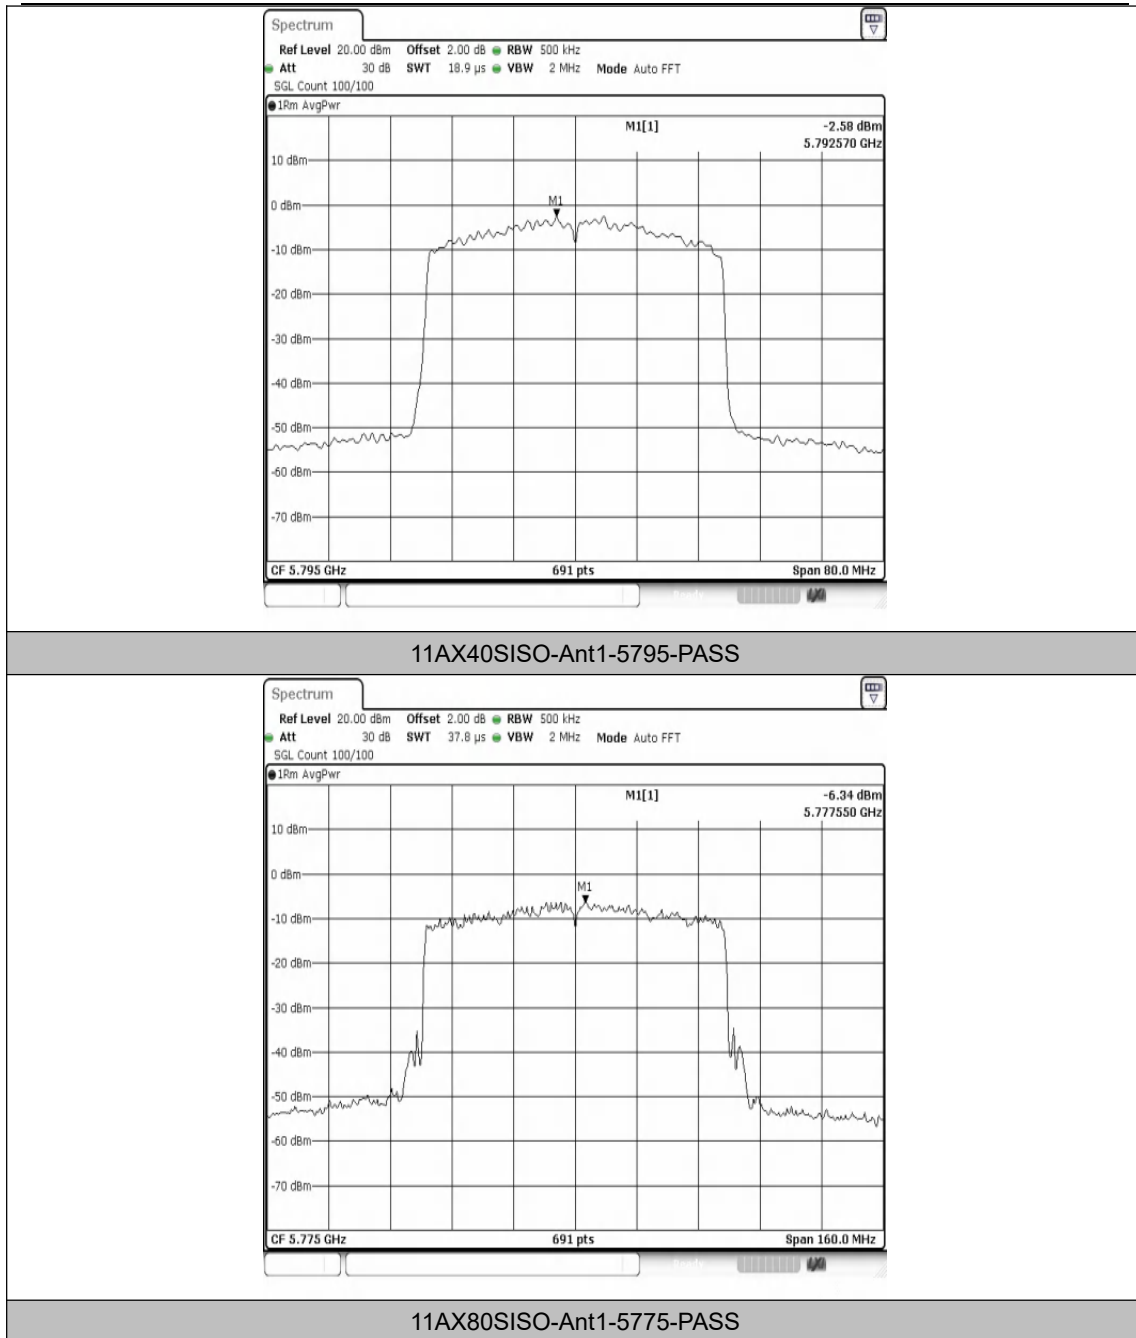

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-32.97	≤-27	PASS
11A	Ant1	High	5320	-38.25	≤-27	PASS
11A	Ant1	Low	5500	-34.8	≤-27	PASS
11A	Ant1	High	5700	-34.94	≤-27	PASS
11N20SISO	Ant1	Low	5180	-32.64	≤-27	PASS
11N20SISO	Ant1	High	5320	-39.47	≤-27	PASS
11N20SISO	Ant1	Low	5500	-37.79	≤-27	PASS
11N20SISO	Ant1	High	5700	-35.66	≤-27	PASS
11N40SISO	Ant1	Low	5190	-32.02	≤-27	PASS
11N40SISO	Ant1	High	5310	-37.12	≤-27	PASS
11N40SISO	Ant1	Low	5510	-34.74	≤-27	PASS
11N40SISO	Ant1	High	5670	-39.55	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-33.58	≤-27	PASS
11AC20SISO	Ant1	High	5320	-38.83	≤-27	PASS
11AC20SISO	Ant1	Low	5500	-37.41	≤-27	PASS
11AC20SISO	Ant1	High	5700	-36.44	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-32.15	≤-27	PASS
11AC40SISO	Ant1	High	5310	-37.05	≤-27	PASS
11AC40SISO	Ant1	Low	5510	-36.51	≤-27	PASS
11AC40SISO	Ant1	High	5670	-37.76	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-33.1	≤-27	PASS
11AC80SISO	Ant1	High	5290	-34.22	≤-27	PASS
11AC80SISO	Ant1	Low	5530	-33.3	≤-27	PASS
11AC80SISO	Ant1	High	5610	-40.35	≤-27	PASS
11AX20SISO	Ant1	Low	5180	-33.77	≤-27	PASS
11AX20SISO	Ant1	High	5320	-39.07	≤-27	PASS
11AX20SISO	Ant1	Low	5500	-36.46	≤-27	PASS
11AX20SISO	Ant1	High	5700	-37.29	≤-27	PASS
11AX40SISO	Ant1	Low	5190	-33.01	≤-27	PASS
11AX40SISO	Ant1	High	5310	-36.8	≤-27	PASS
11AX40SISO	Ant1	Low	5510	-34.02	≤-27	PASS
11AX40SISO	Ant1	High	5670	-38.34	≤-27	PASS
11AX80SISO	Ant1	Low	5210	-31.41	≤-27	PASS
11AX80SISO	Ant1	High	5290	-31.18	≤-27	PASS
11AX80SISO	Ant1	Low	5530	-34.28	≤-27	PASS
11AX80SISO	Ant1	High	5610	-39.47	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-35.92	≤15.98	PASS
11A	Ant1	Low	5745	5700~5720	-36.56	≤10.09	PASS
11A	Ant1	Low	5745	5650~5700	-40.44	≤-25.27	PASS
11A	Ant1	Low	5745	5760~5650	-41.65	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-33.94	≤16.10	PASS
11A	Ant1	High	5825	5855~5875	-35.82	≤11.11	PASS
11A	Ant1	High	5825	5875~5925	-41.08	≤-26.73	PASS
11A	Ant1	High	5825	5925~5935	-40.4	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-37.84	≤16.74	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-36.84	≤11.77	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-42.58	≤-26.51	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-41.19	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-37.31	≤15.65	PASS
11N20SISO	Ant1	High	5825	5855~5875	-38.06	≤10.13	PASS
11N20SISO	Ant1	High	5825	5875~5925	-42.23	≤-26.87	PASS
11N20SISO	Ant1	High	5825	5925~5935	-41.07	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-35.96	≤17.24	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-38.87	≤10.60	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-41.1	≤-26.94	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-40.65	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-37.6	≤15.85	PASS
11N40SISO	Ant1	High	5795	5855~5875	-38.77	≤11.08	PASS
11N40SISO	Ant1	High	5795	5875~5925	-41.34	≤-26.97	PASS
11N40SISO	Ant1	High	5795	5925~5935	-40.47	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-36.03	≤17.50	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-38.45	≤11.26	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-40.29	≤-25.64	PASS
11AC20SISO	Ant1	Low	5745	5760~5650	-40.81	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-35.67	≤15.65	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-35.81	≤11.44	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-42.16	≤-26.73	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-39.5	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-36.77	≤15.90	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-34.45	≤12.40	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-42.05	≤-26.94	PASS
11AC40SISO	Ant1	Low	5755	5780~5650	-41.28	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-40.52	≤15.85	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-39.55	≤10.34	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-41.7	≤-26.79	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC40SISO	Ant1	High	5795	5925~5935	-40.65	≤-27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-37.56	≤17.20	PASS
11AC80SISO	Ant1	Low	5775	5700~5720	-40.56	≤10.58	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-42.25	≤-26.88	PASS
11AC80SISO	Ant1	Low	5775	5800~5650	-40.38	≤-27	PASS
11AC80SISO	Ant1	High	5775	5850~5855	-35.61	≤15.98	PASS
11AC80SISO	Ant1	High	5775	5855~5875	-36.55	≤11.37	PASS
11AC80SISO	Ant1	High	5775	5875~5925	-41.99	≤-26.66	PASS
11AC80SISO	Ant1	High	5775	5925~5935	-40.25	≤-27	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-34.02	≤10.93	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-41.59	≤-26.63	PASS
11AX20SISO	Ant1	Low	5745	5760~5650	-40.87	≤-27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-37	≤15.98	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-33.8	≤15.65	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-33.92	≤12.70	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-39.71	≤-25.71	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-40.53	≤-27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-36.75	≤15.90	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-39.32	≤10.16	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-41.58	≤-26.50	PASS
11AX40SISO	Ant1	Low	5755	5780~5650	-41.39	≤-27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-38.45	≤16.39	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-39.85	≤10.14	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-41.73	≤-26.97	PASS
11AX40SISO	Ant1	High	5795	5925~5935	-40.94	≤-27	PASS
11AX80SISO	Ant1	Low	5775	5720~5725	-27.64	≤15.67	PASS
11AX80SISO	Ant1	Low	5775	5700~5720	-27.06	≤14.54	PASS
11AX80SISO	Ant1	Low	5775	5650~5700	-43.36	≤-26.88	PASS
11AX80SISO	Ant1	Low	5775	5800~5650	-40.55	≤-27	PASS
11AX80SISO	Ant1	High	5775	5850~5855	-37.14	≤15.98	PASS
11AX80SISO	Ant1	High	5775	5855~5875	-35.67	≤10.69	PASS
11AX80SISO	Ant1	High	5775	5875~5925	-41.18	≤-26.86	PASS
11AX80SISO	Ant1	High	5775	5925~5935	-40.51	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.

Test Graphs B1/2/3

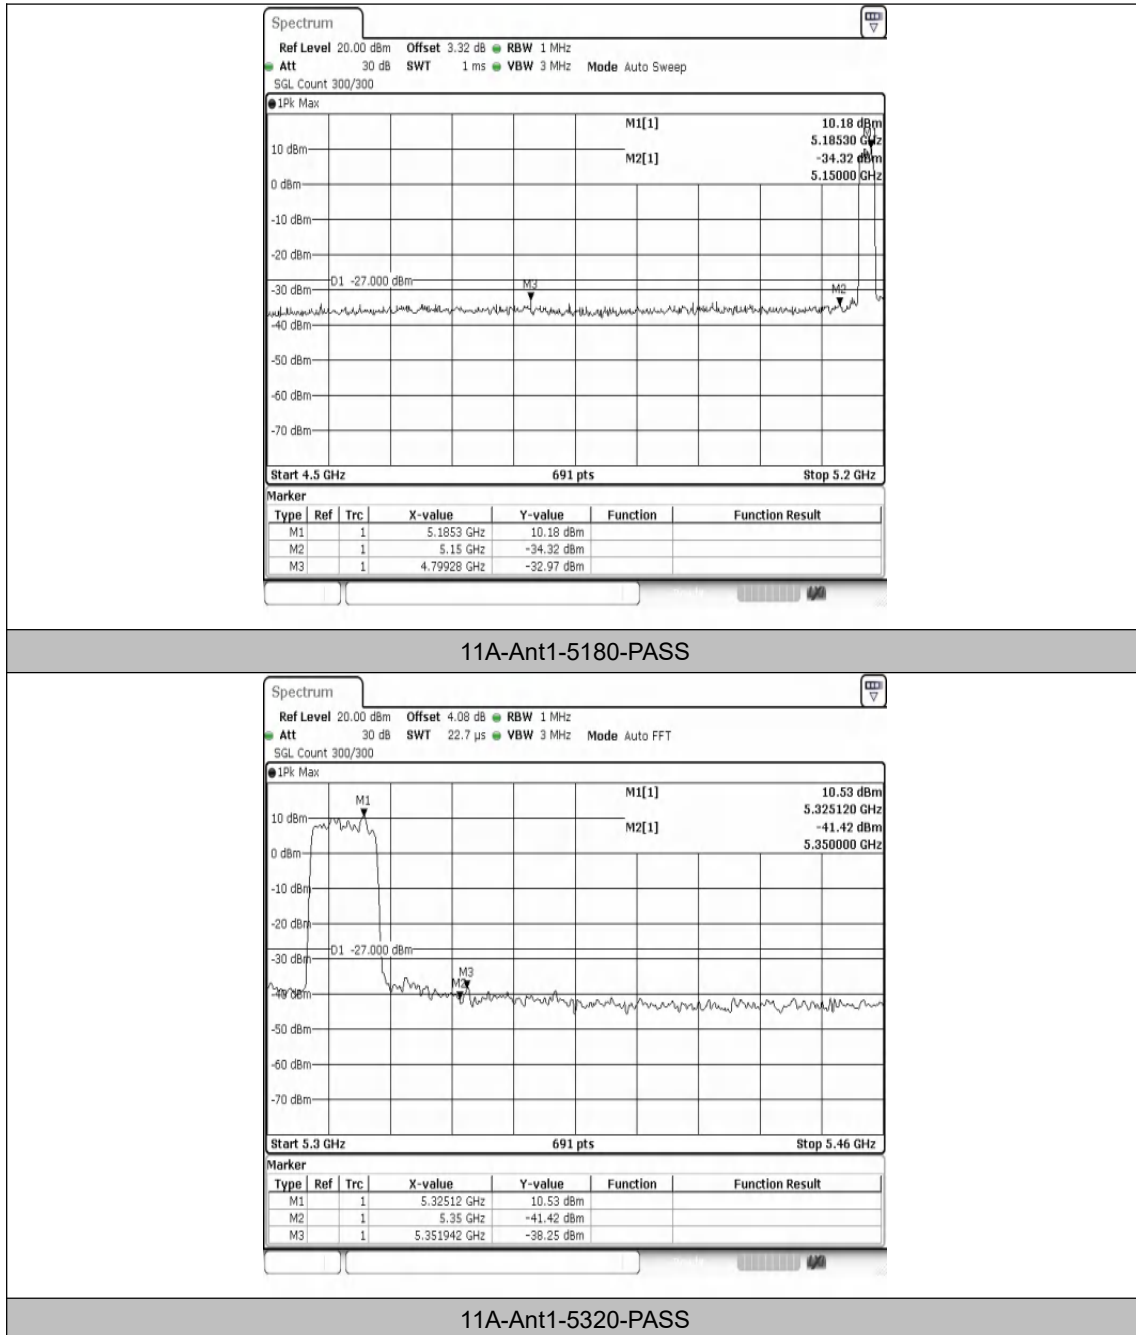


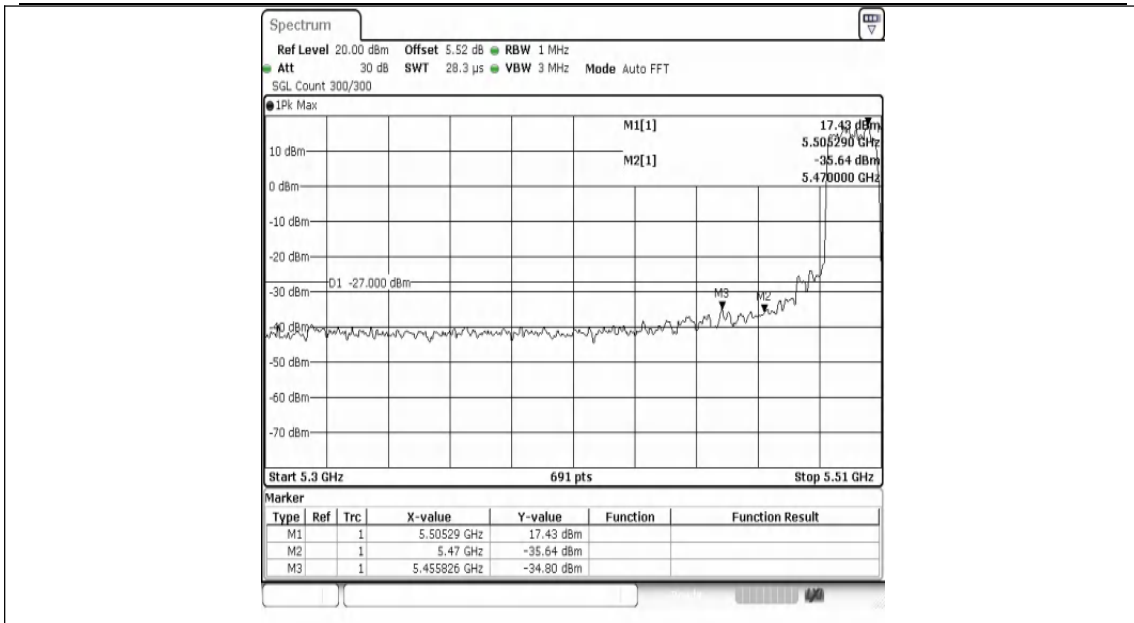

11A-Ant1-5500-PASS

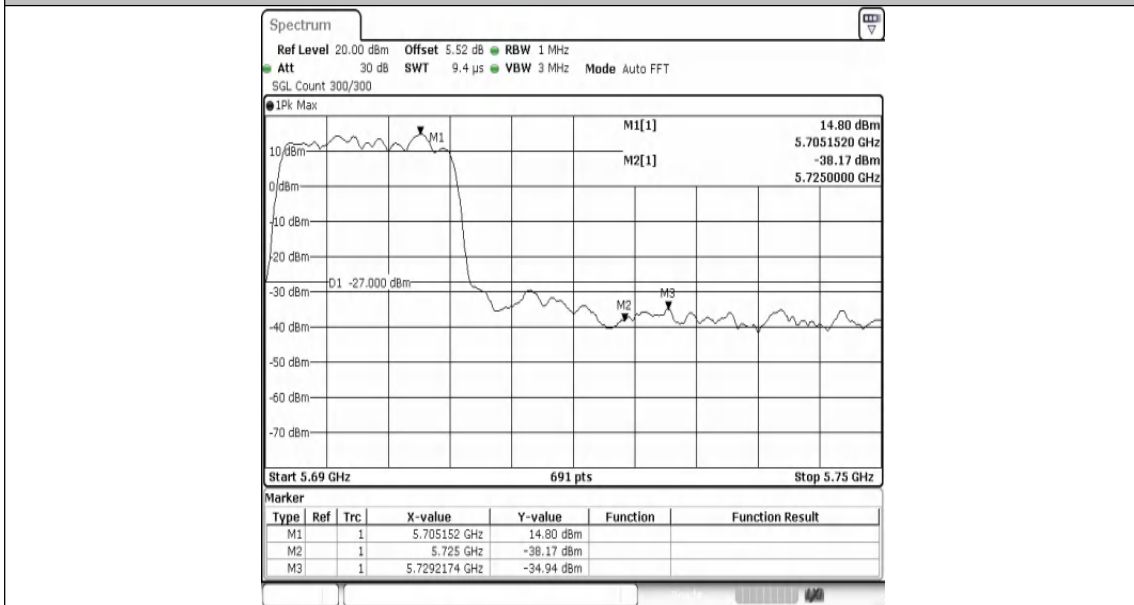


11A-Ant1-5700-PASS

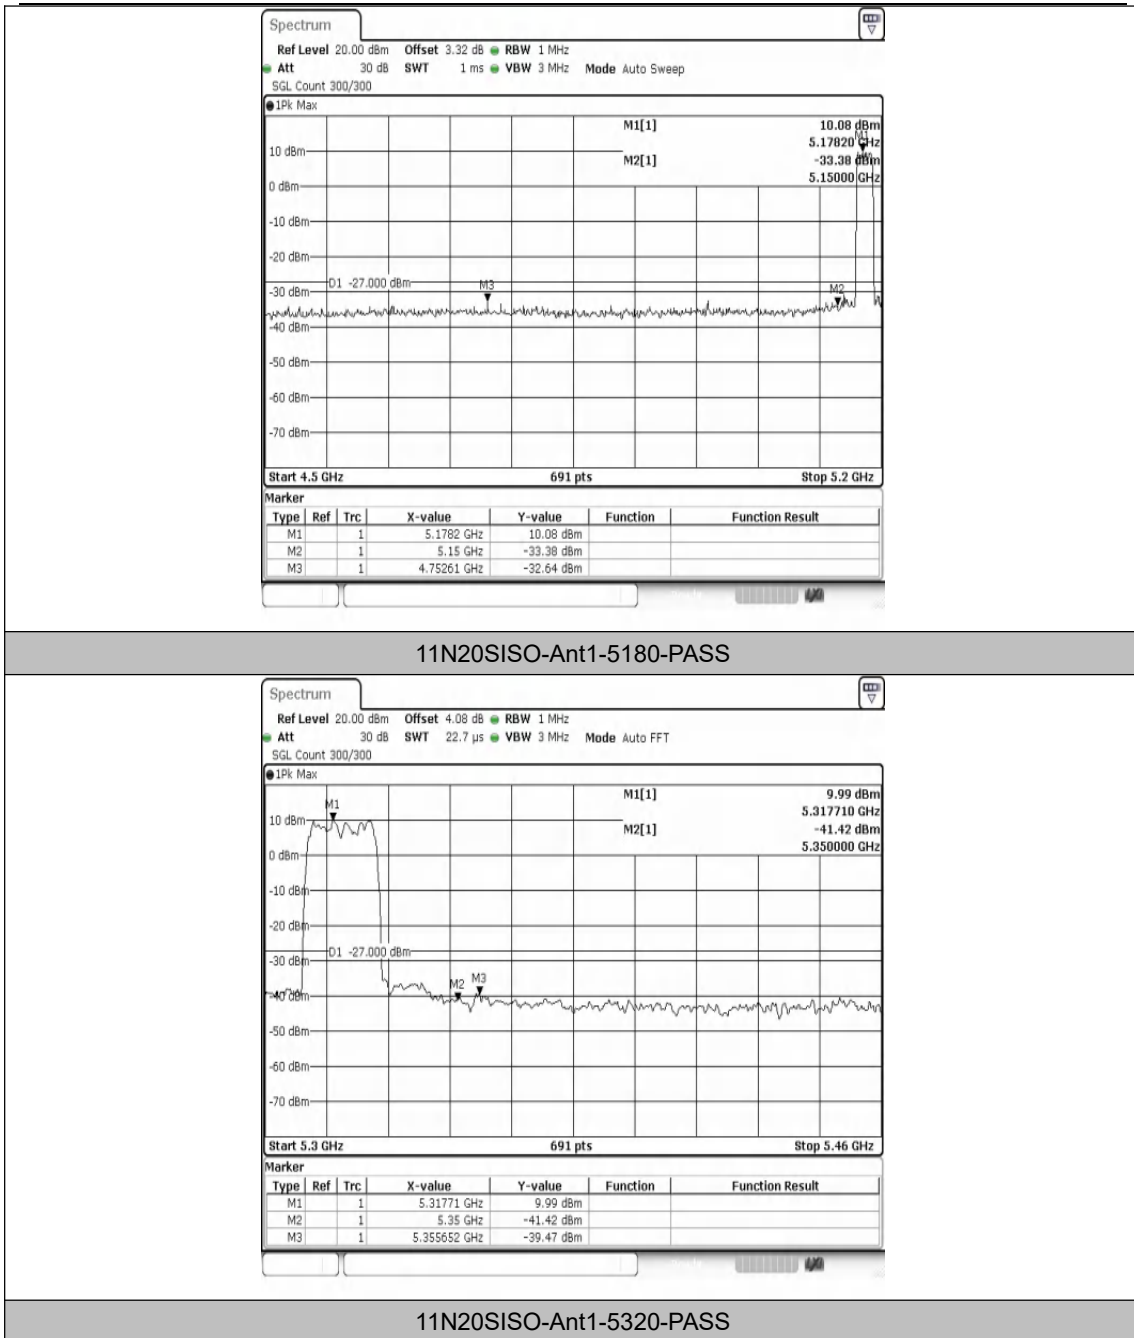


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

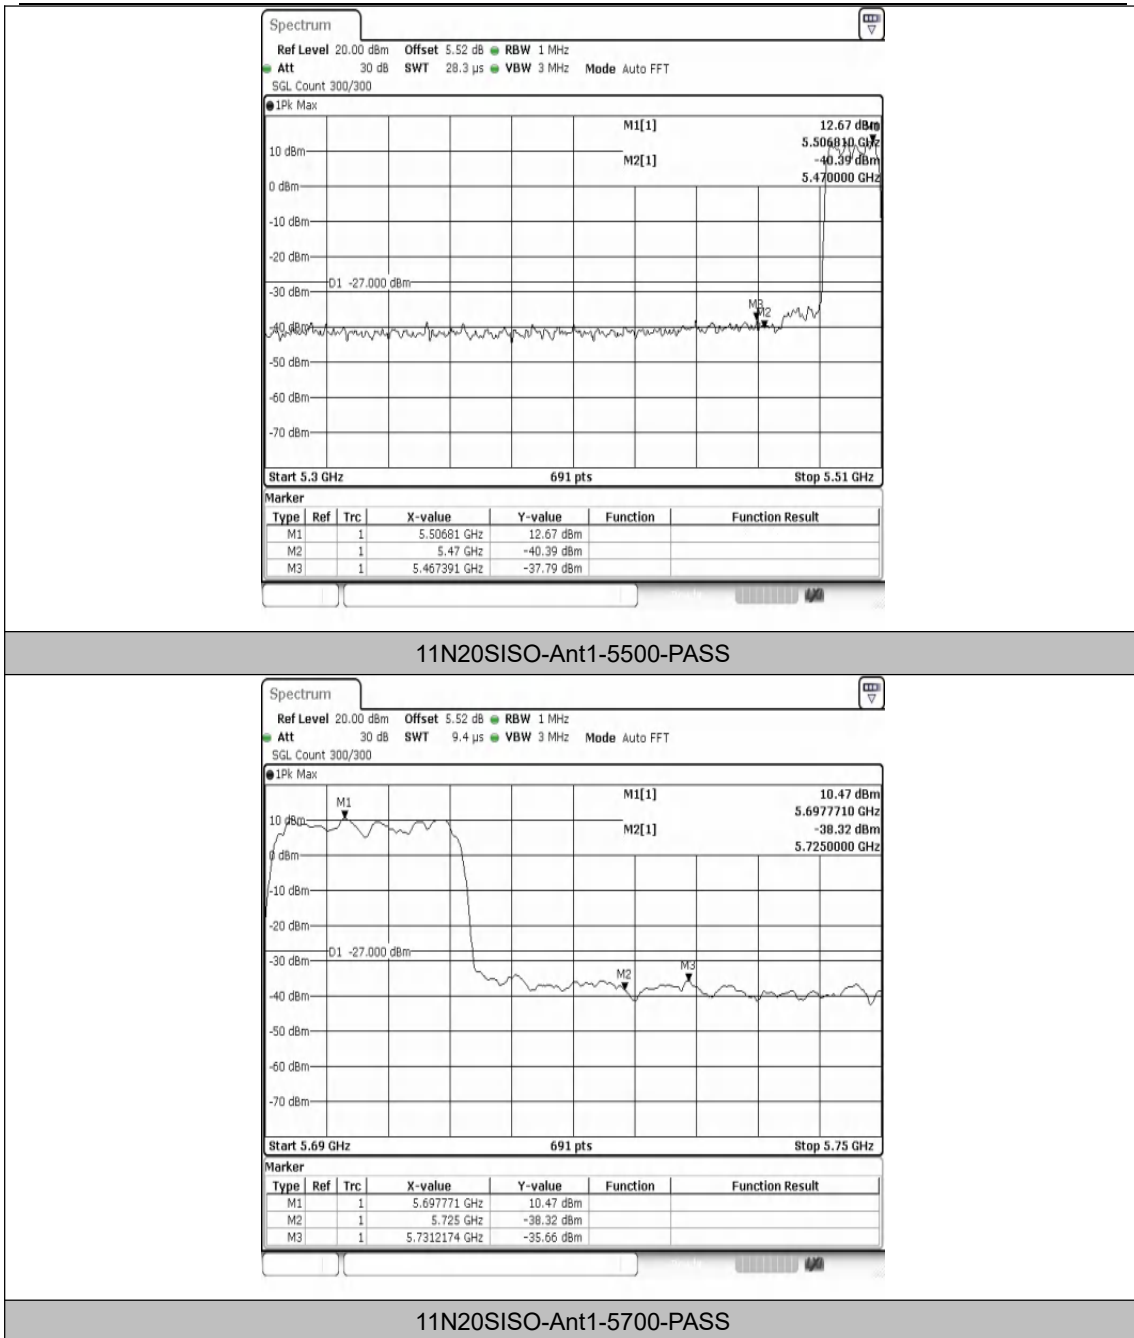


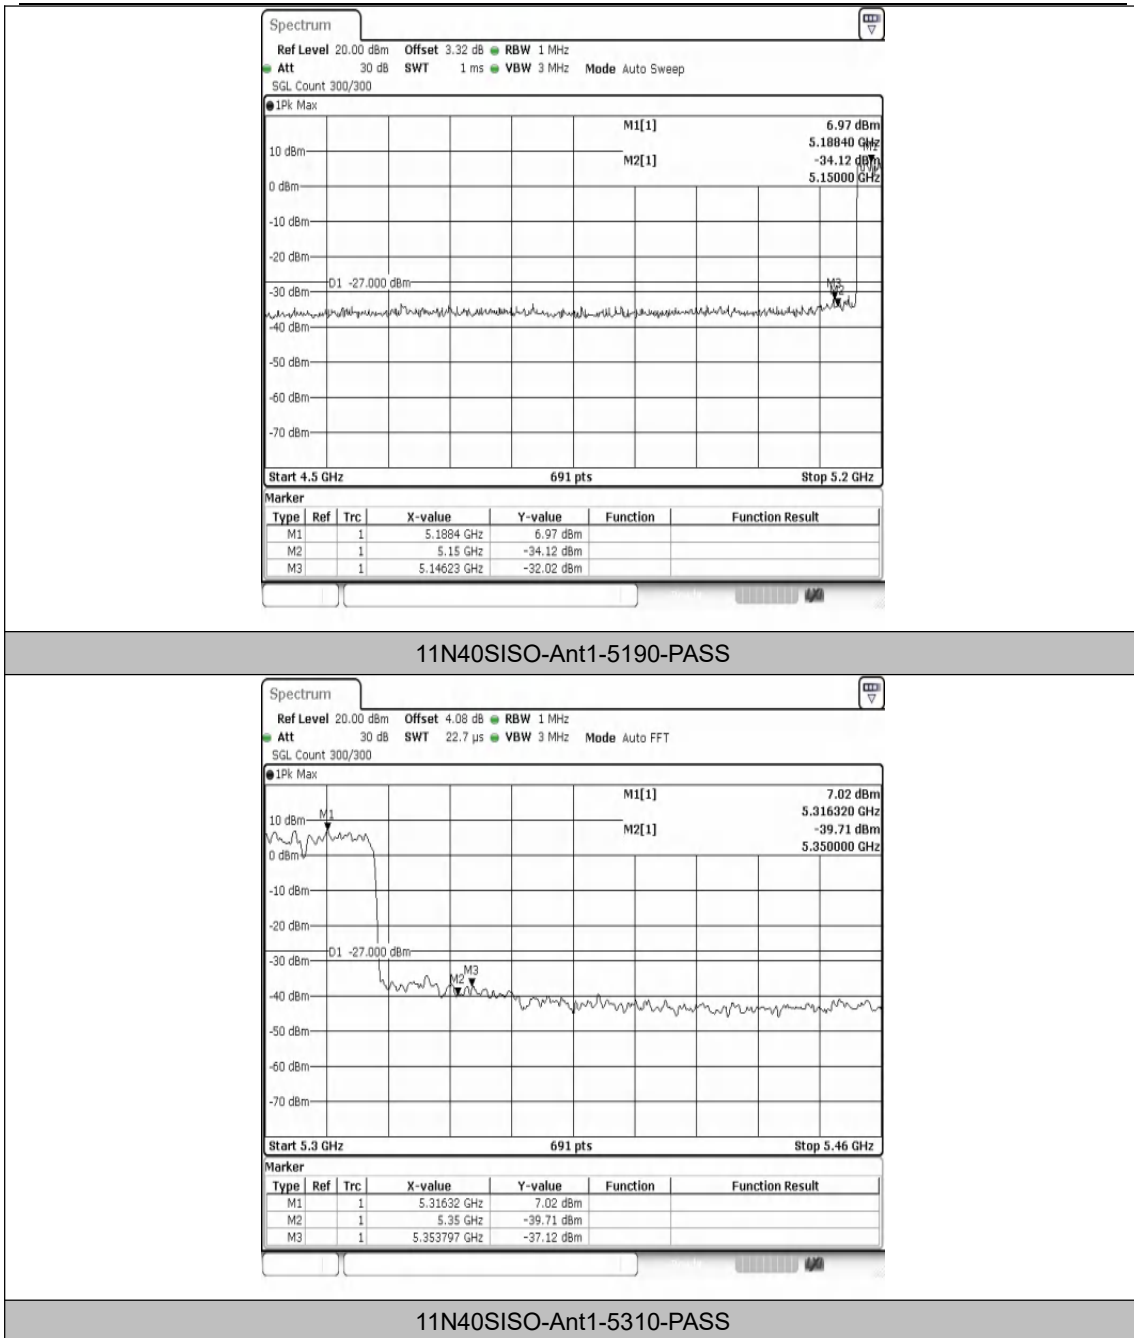

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

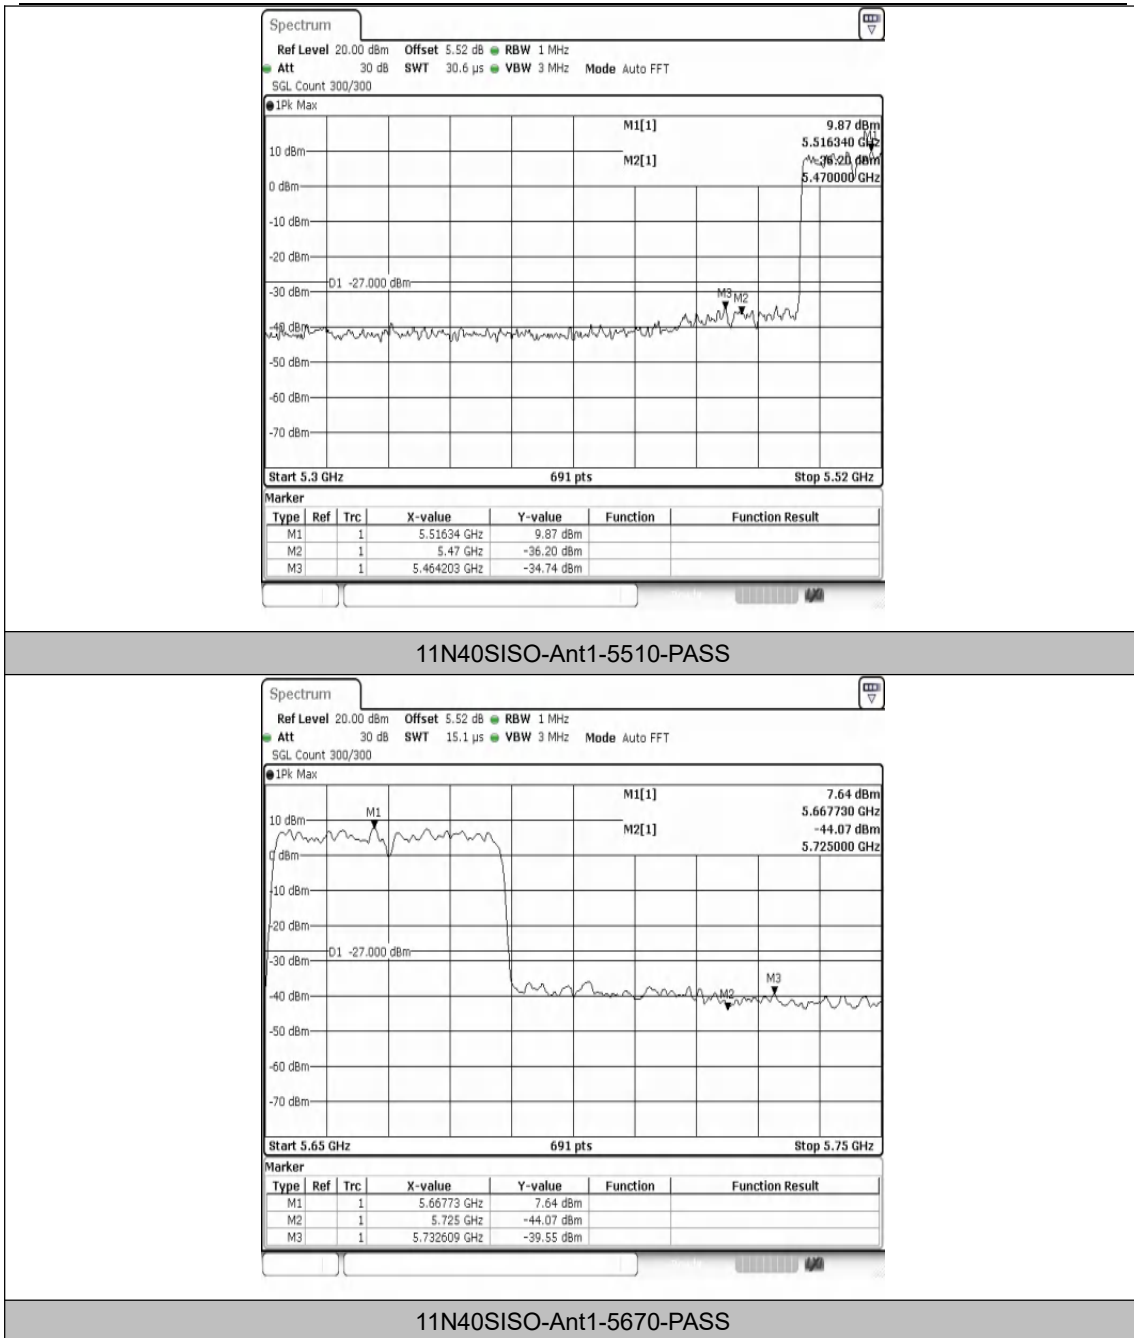



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

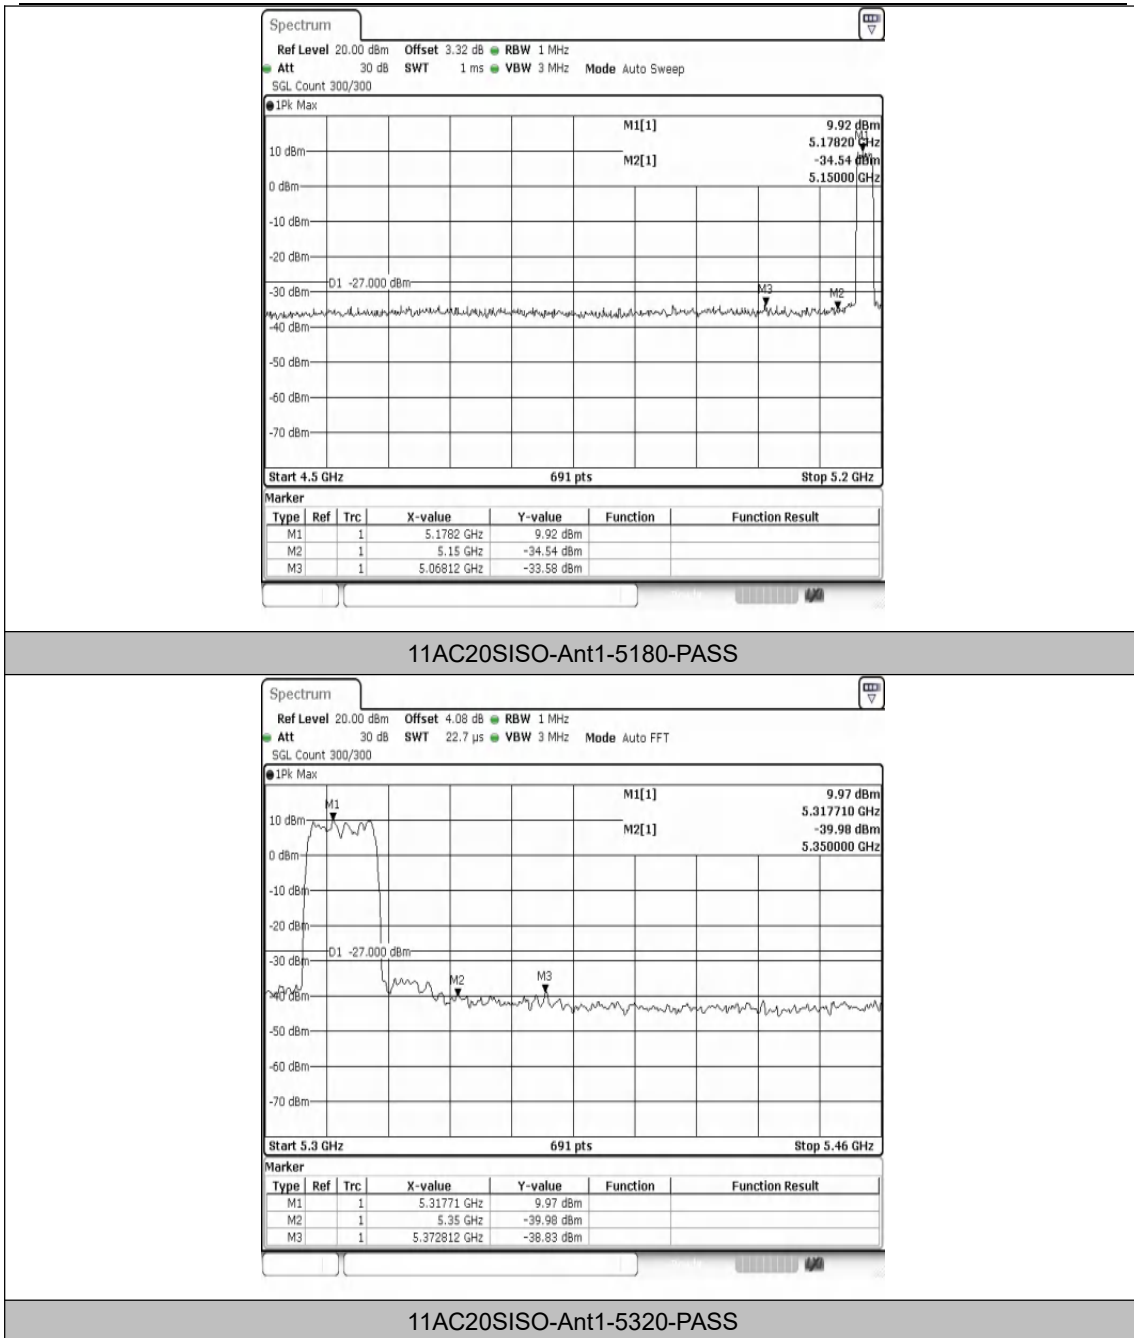

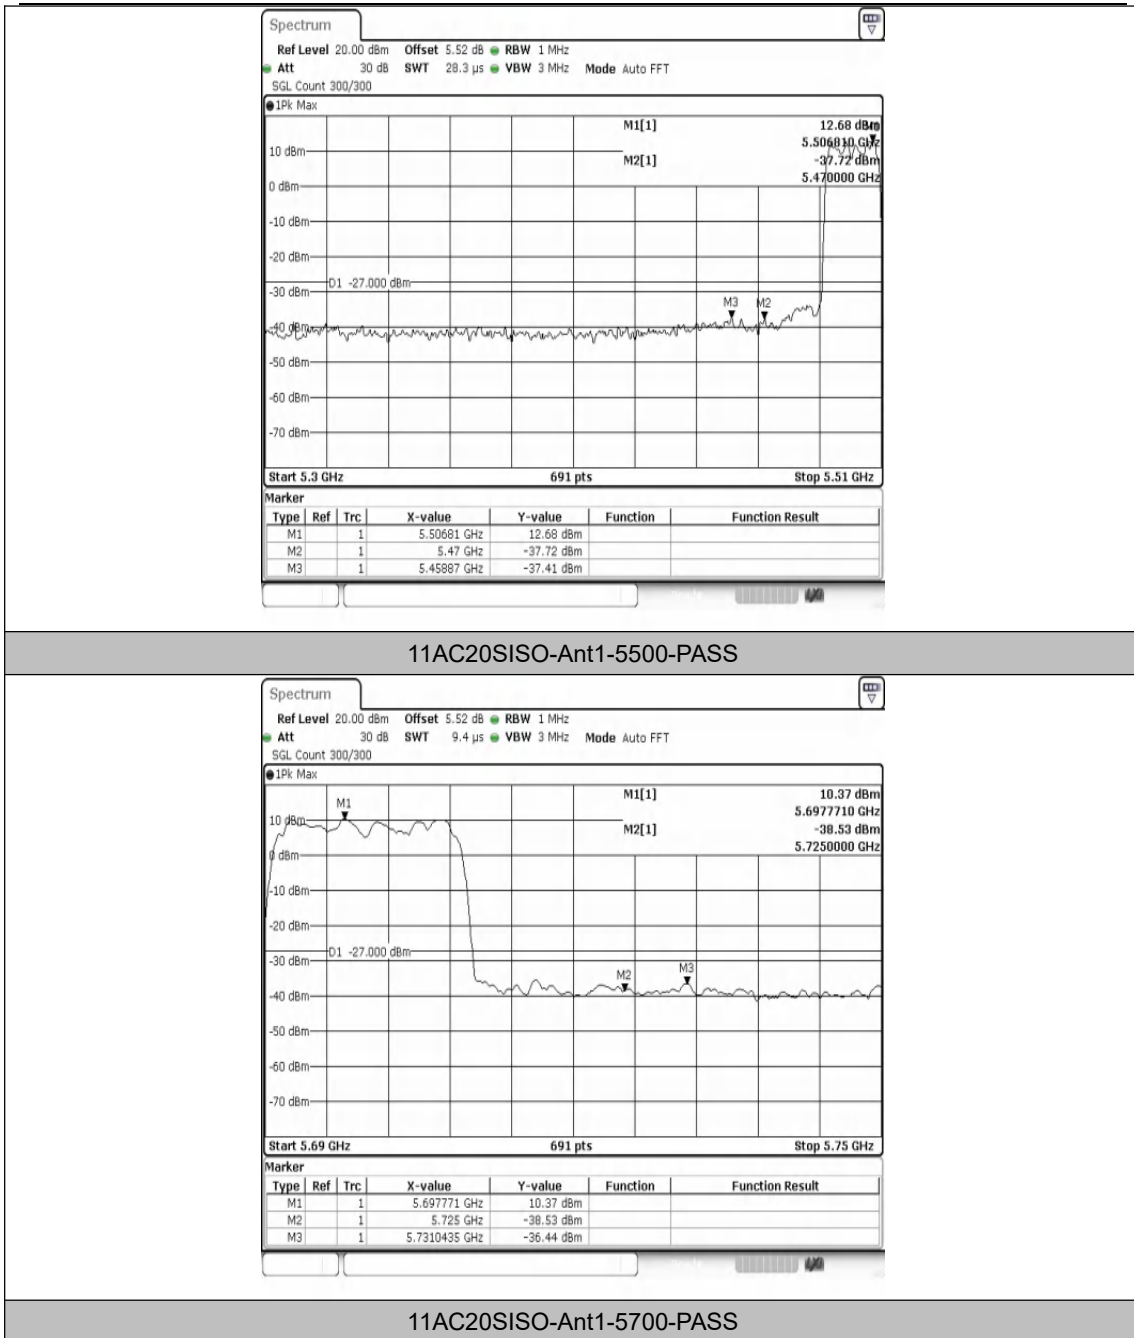

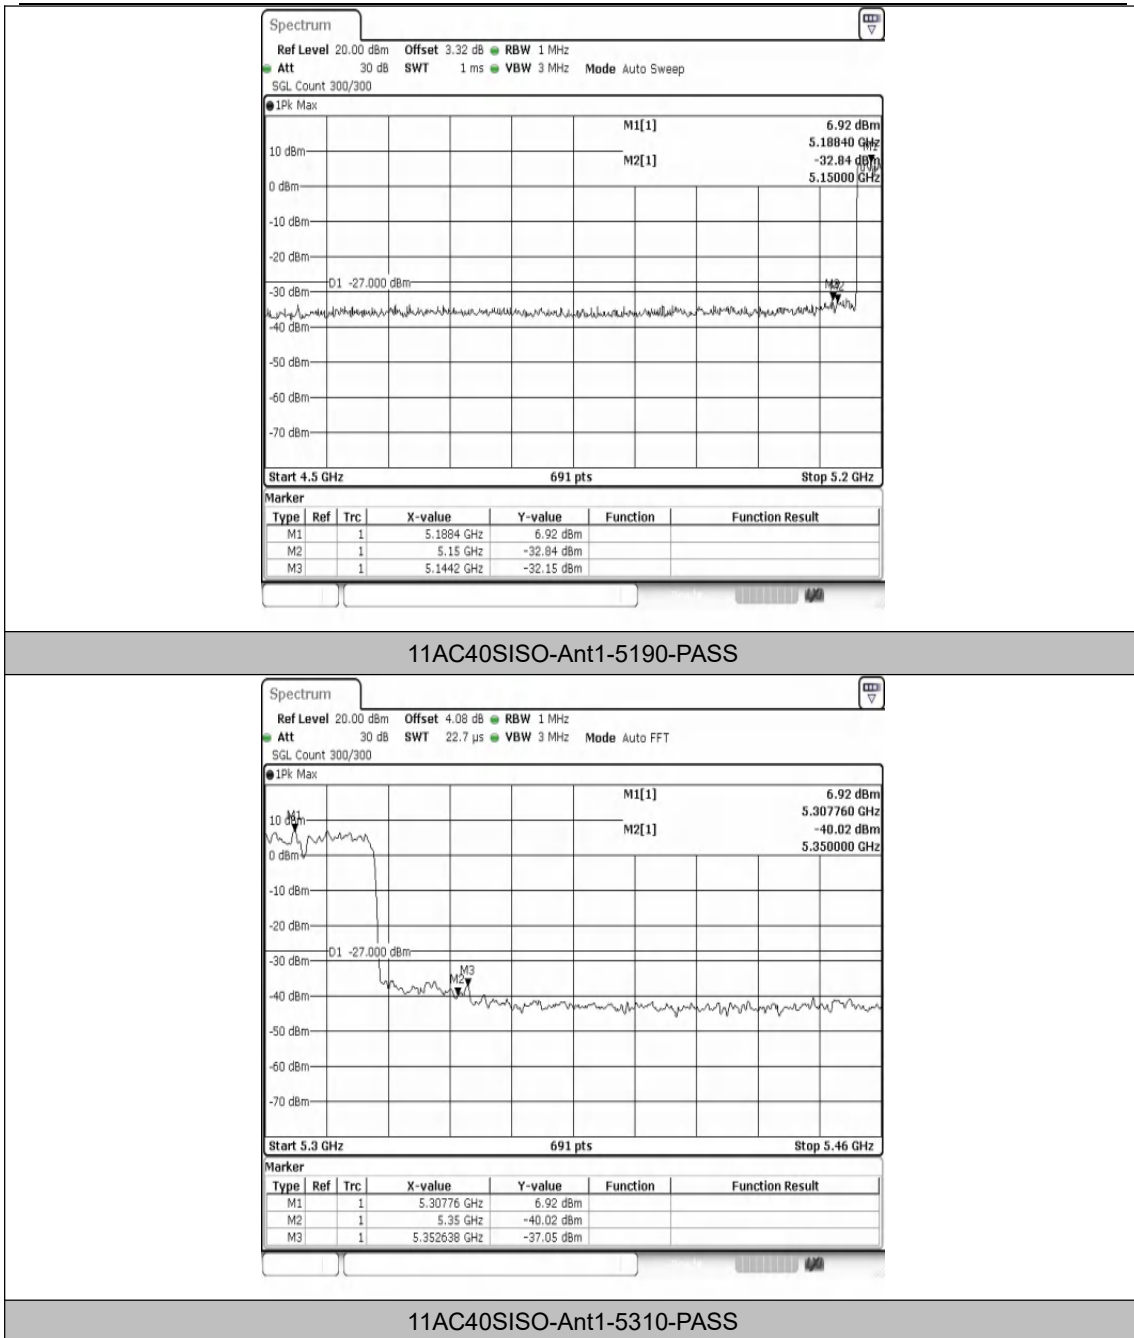


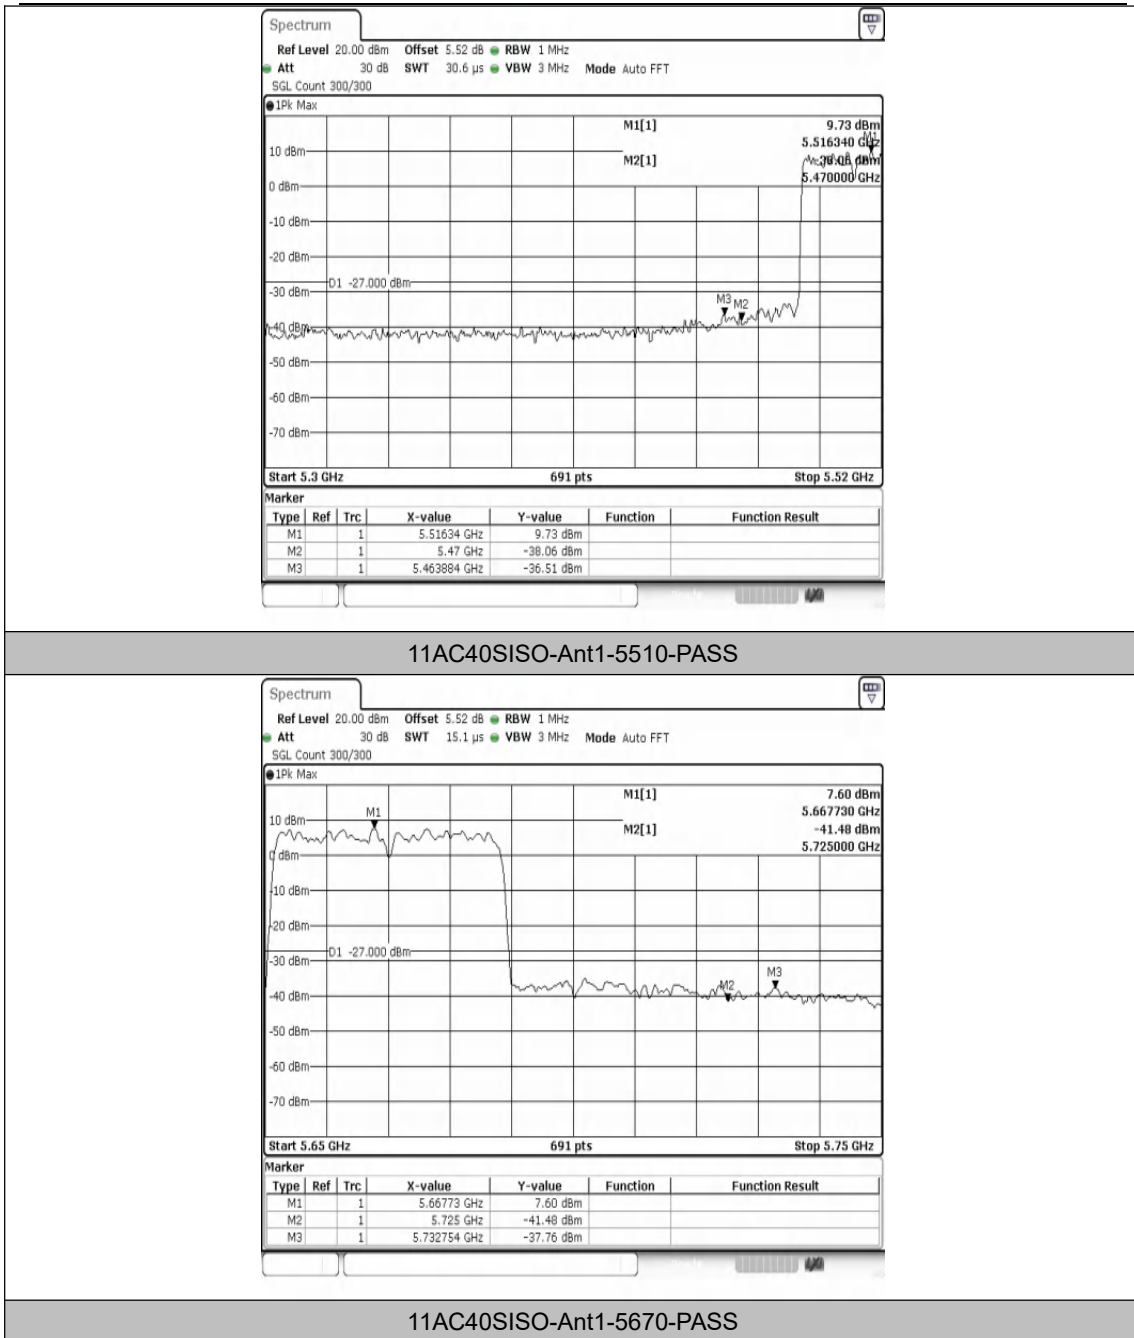



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

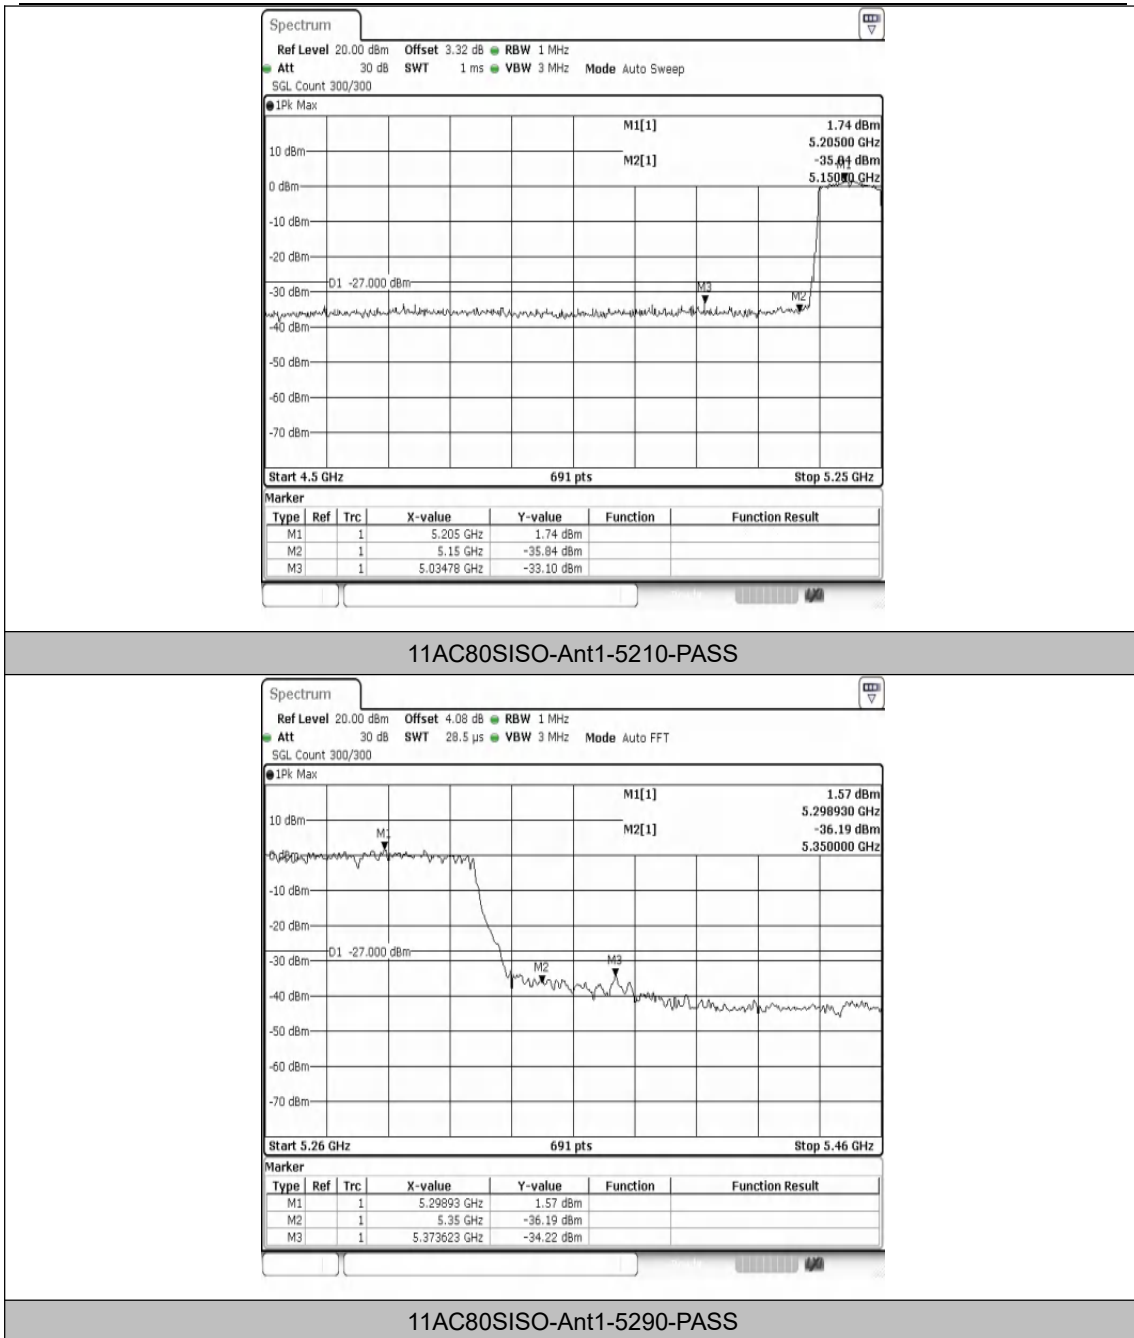

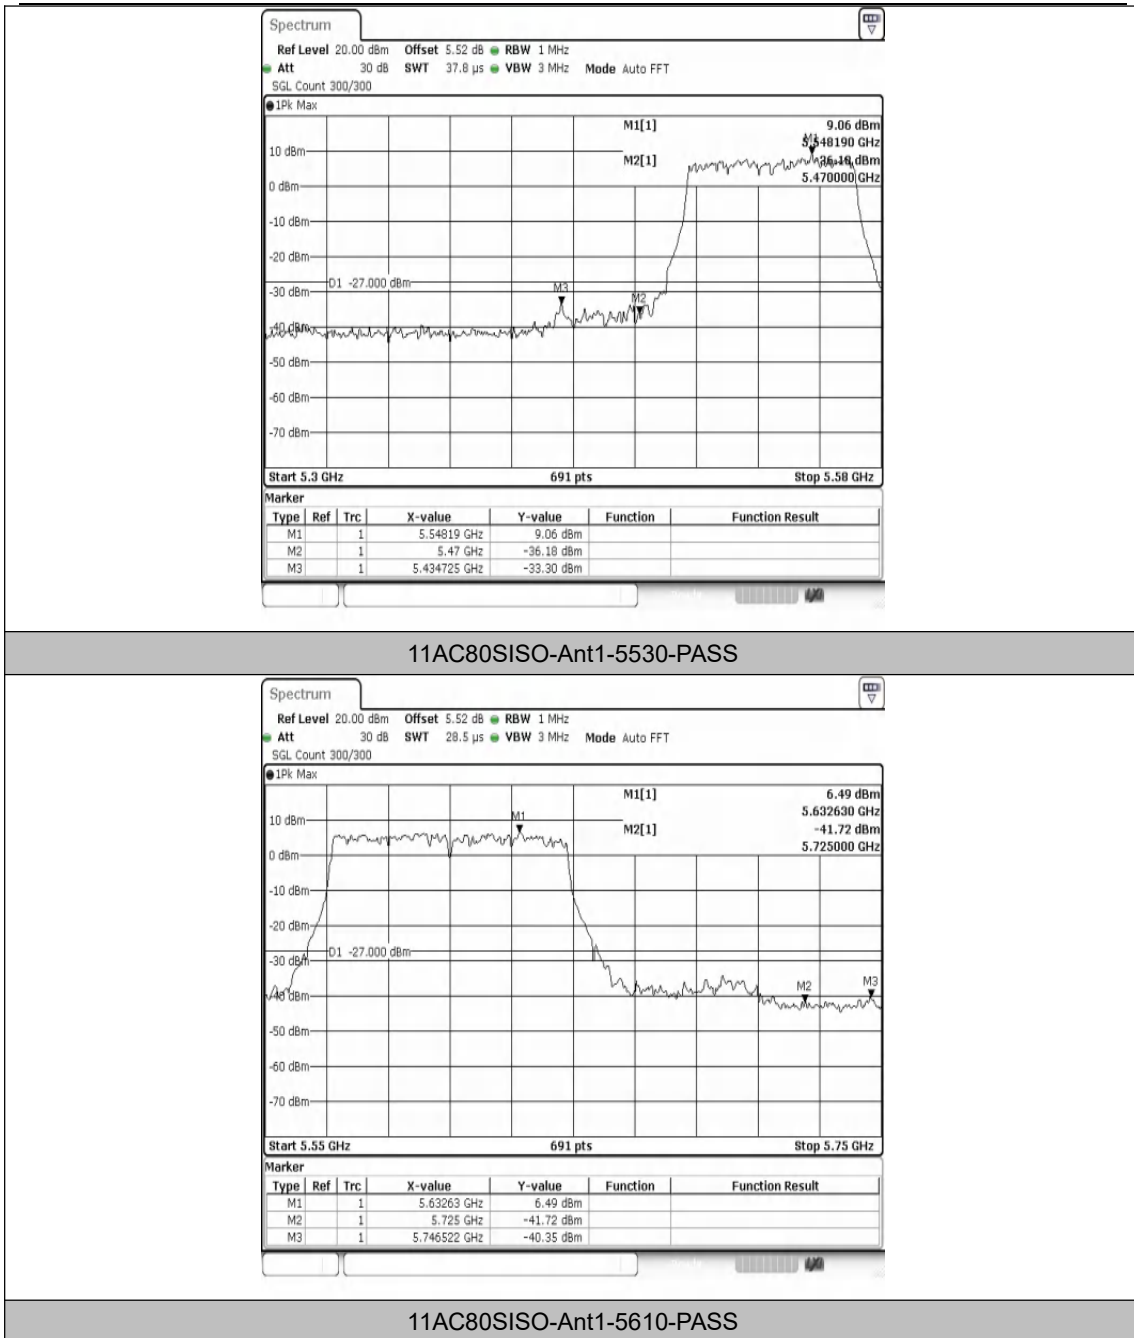


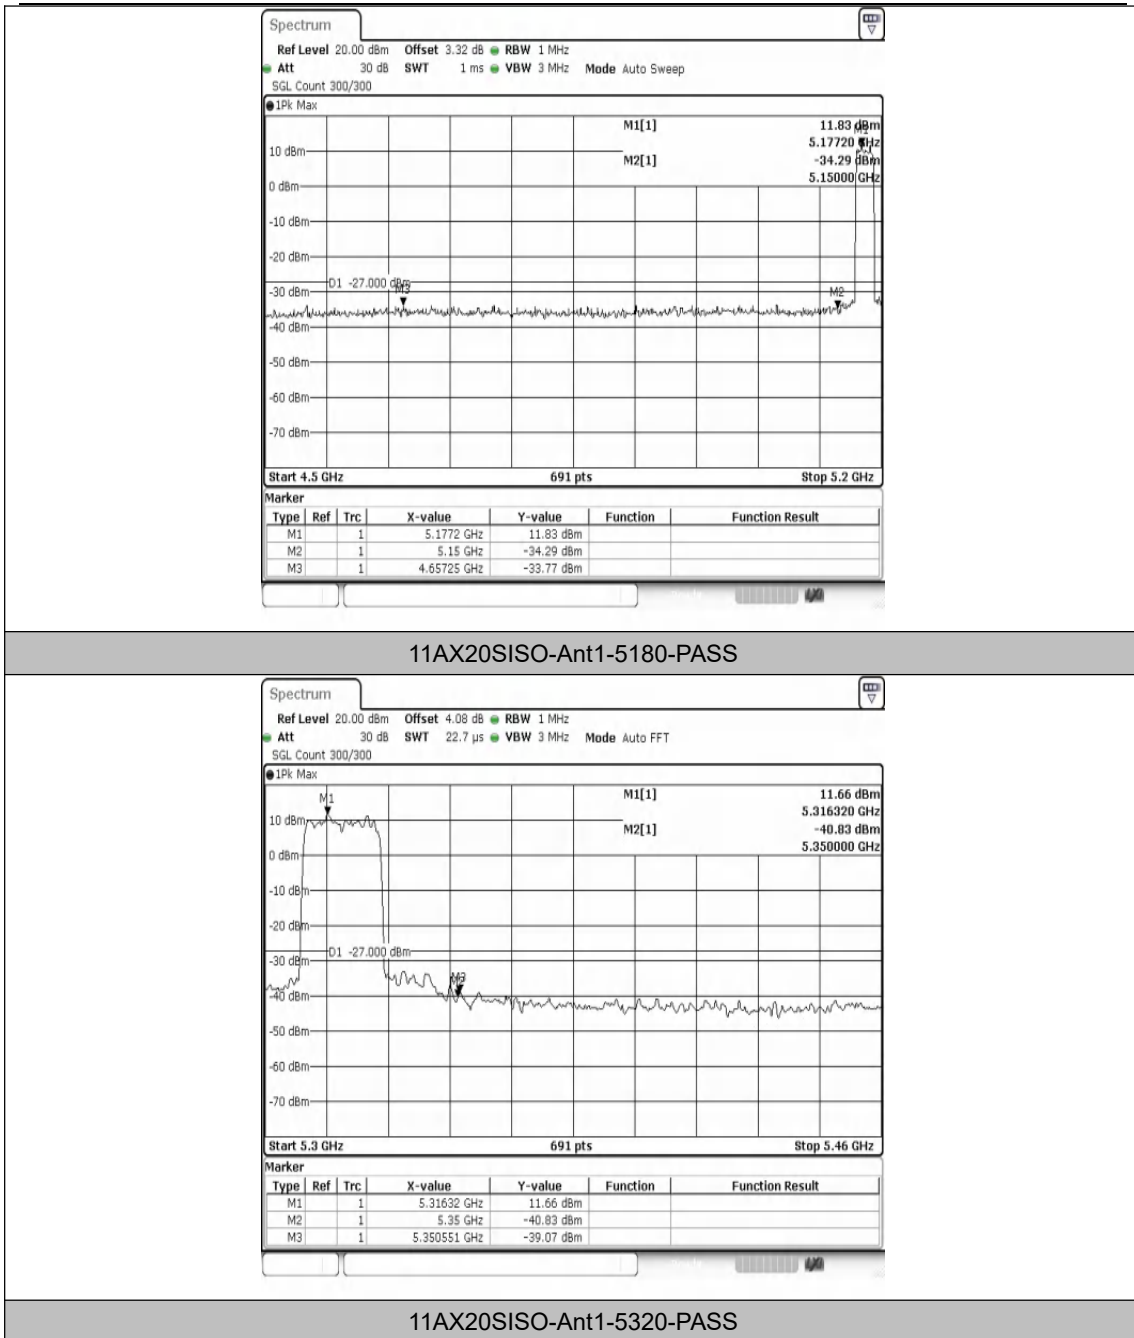


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

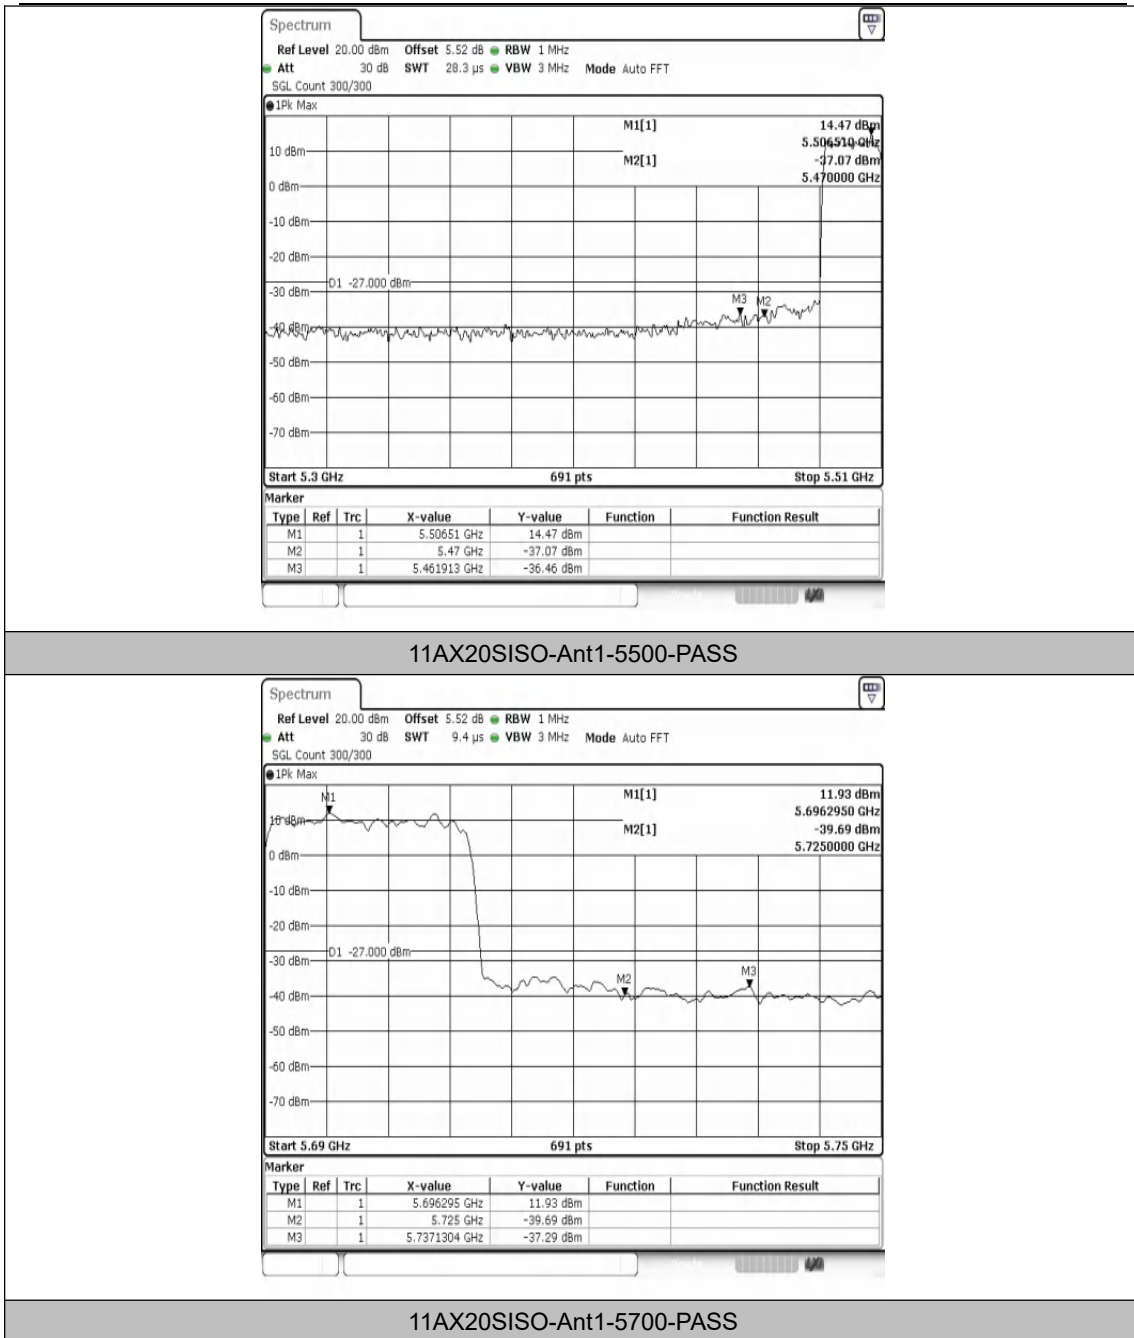


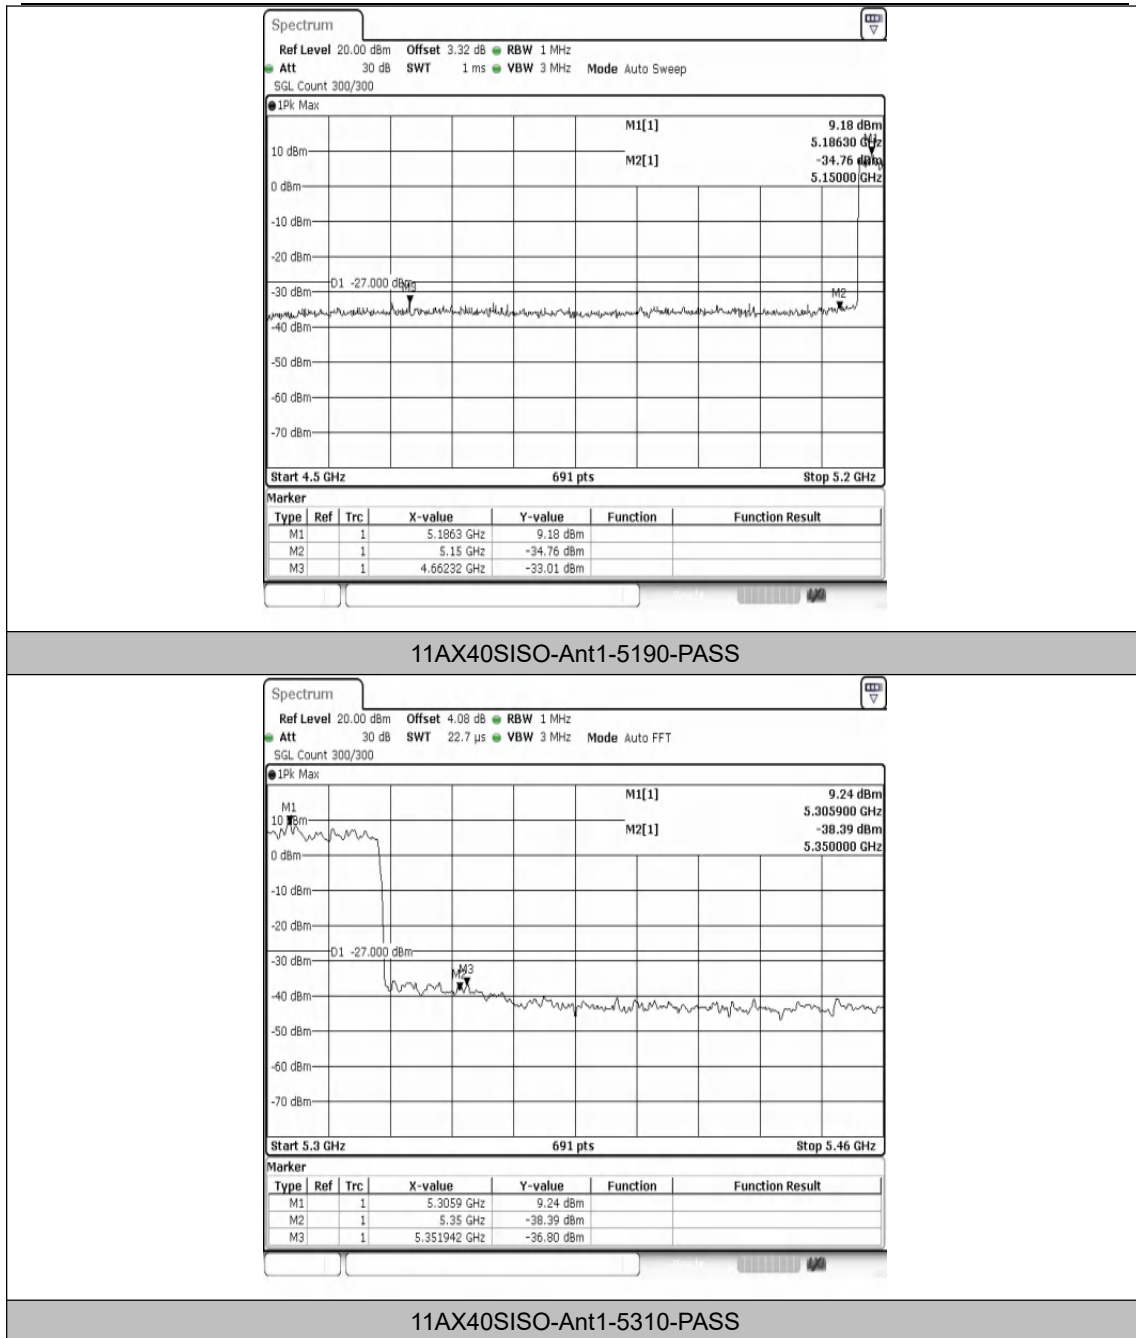

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

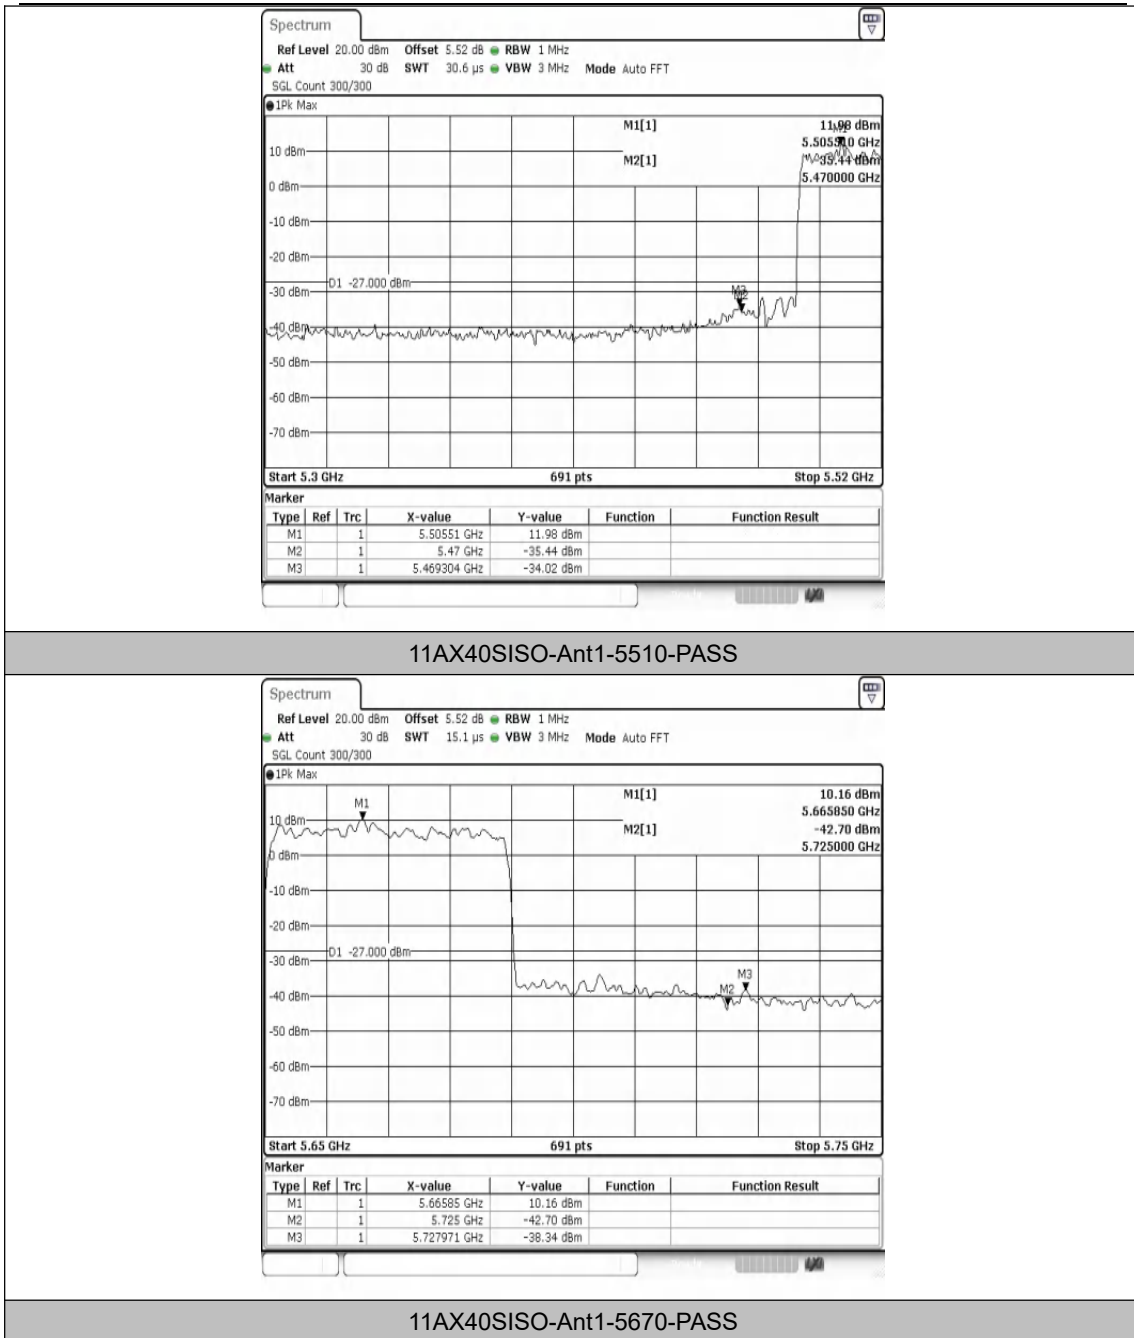


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

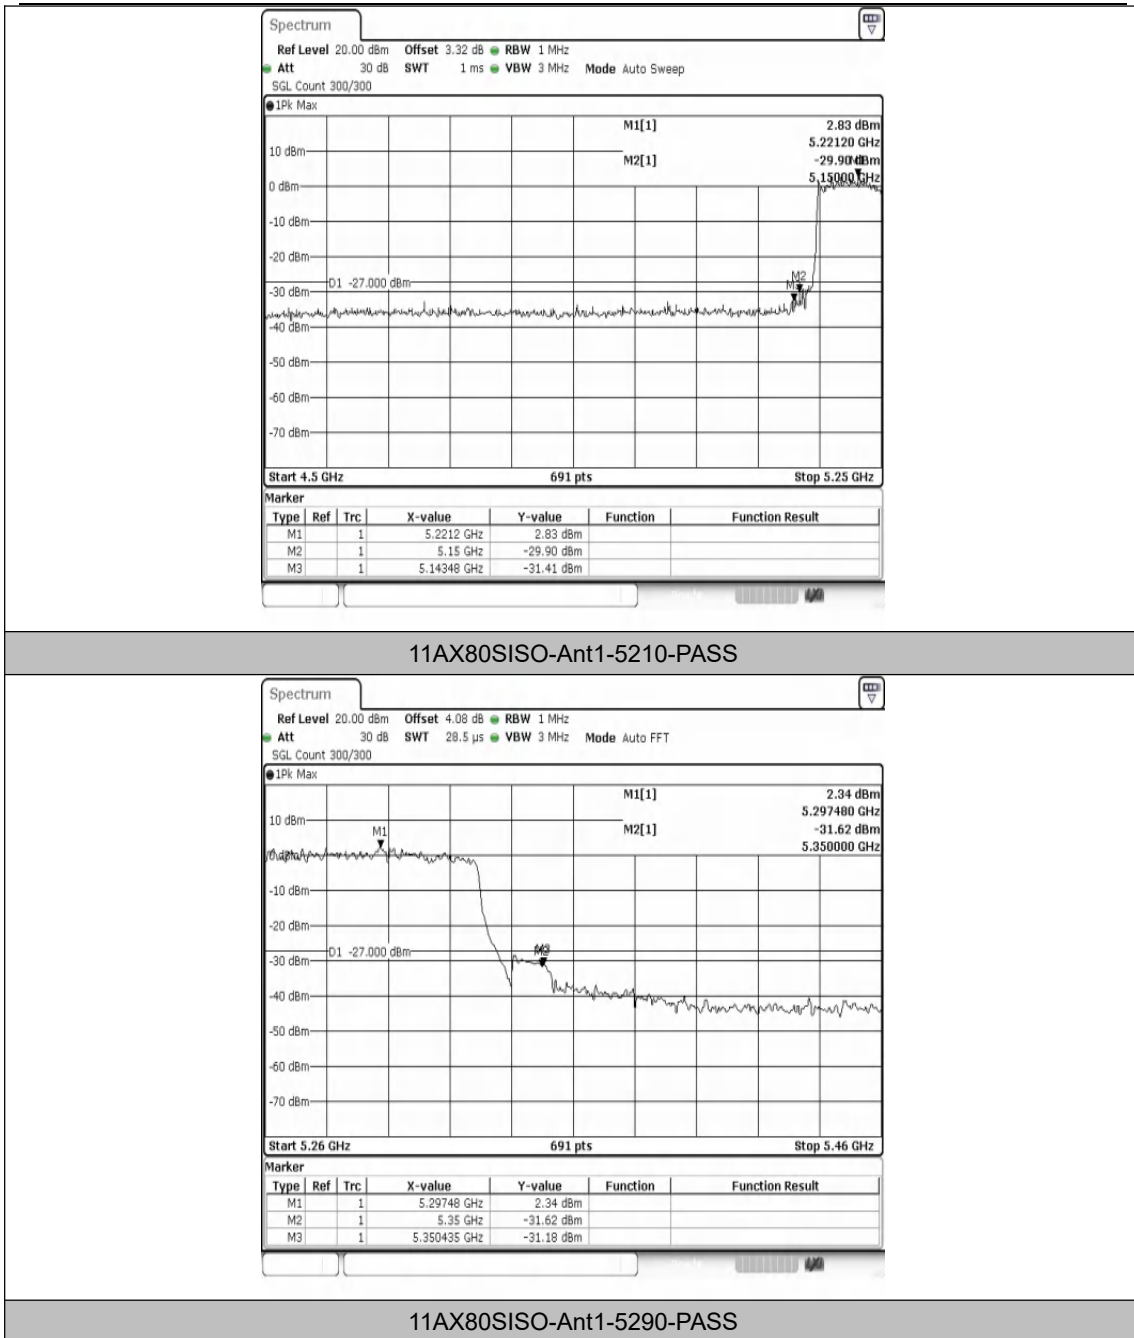


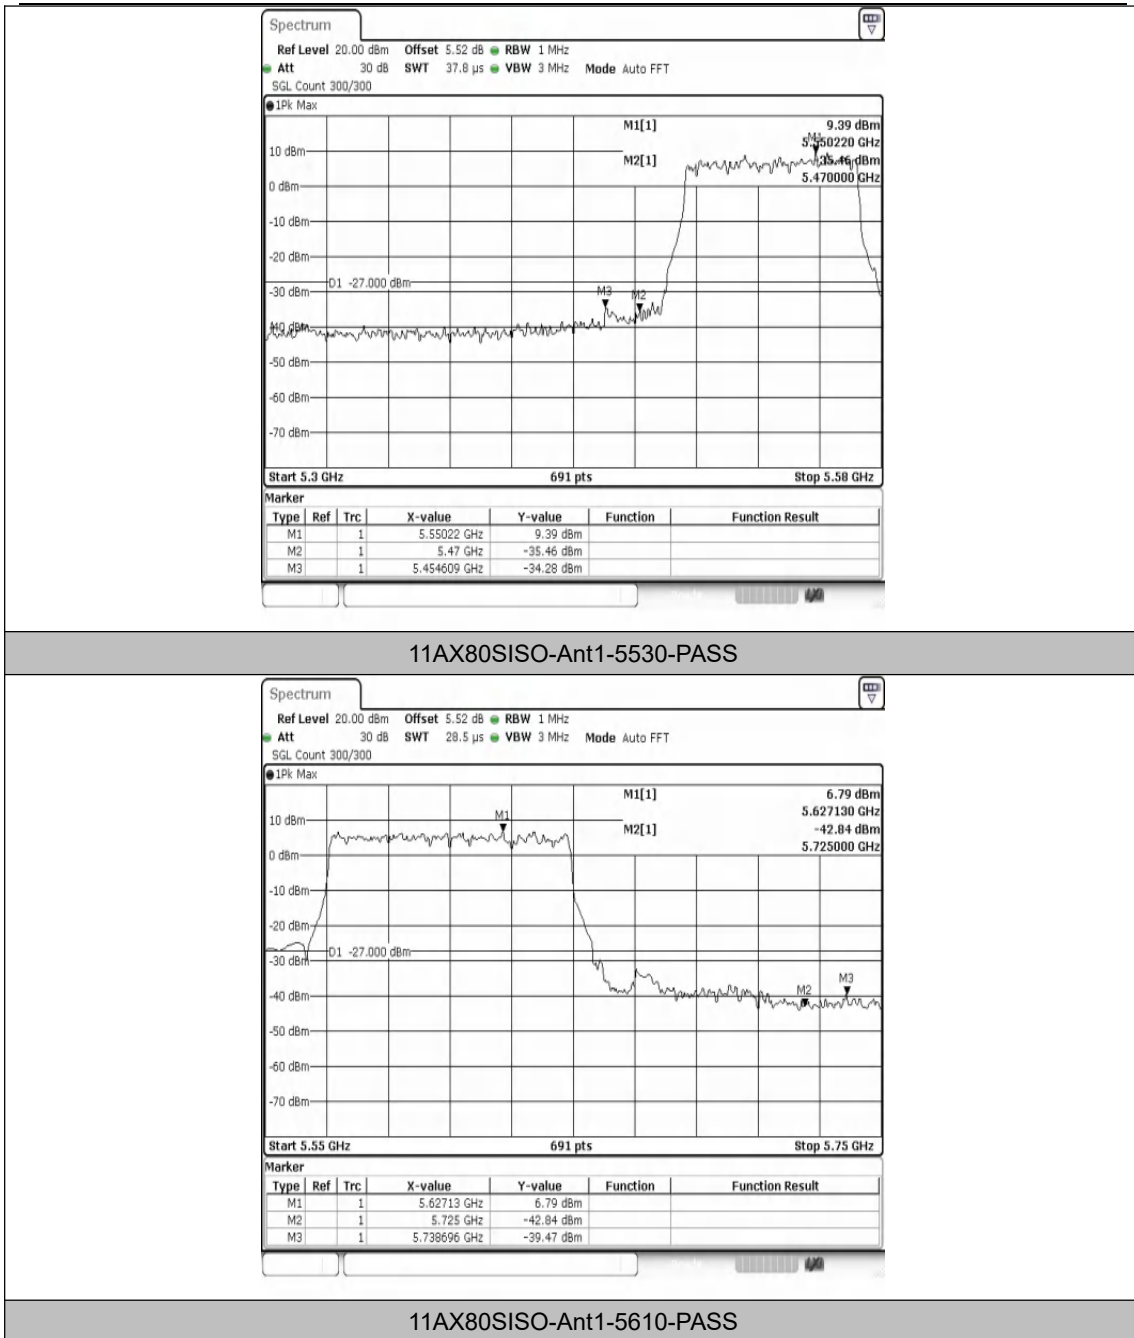

Test Graphs B4

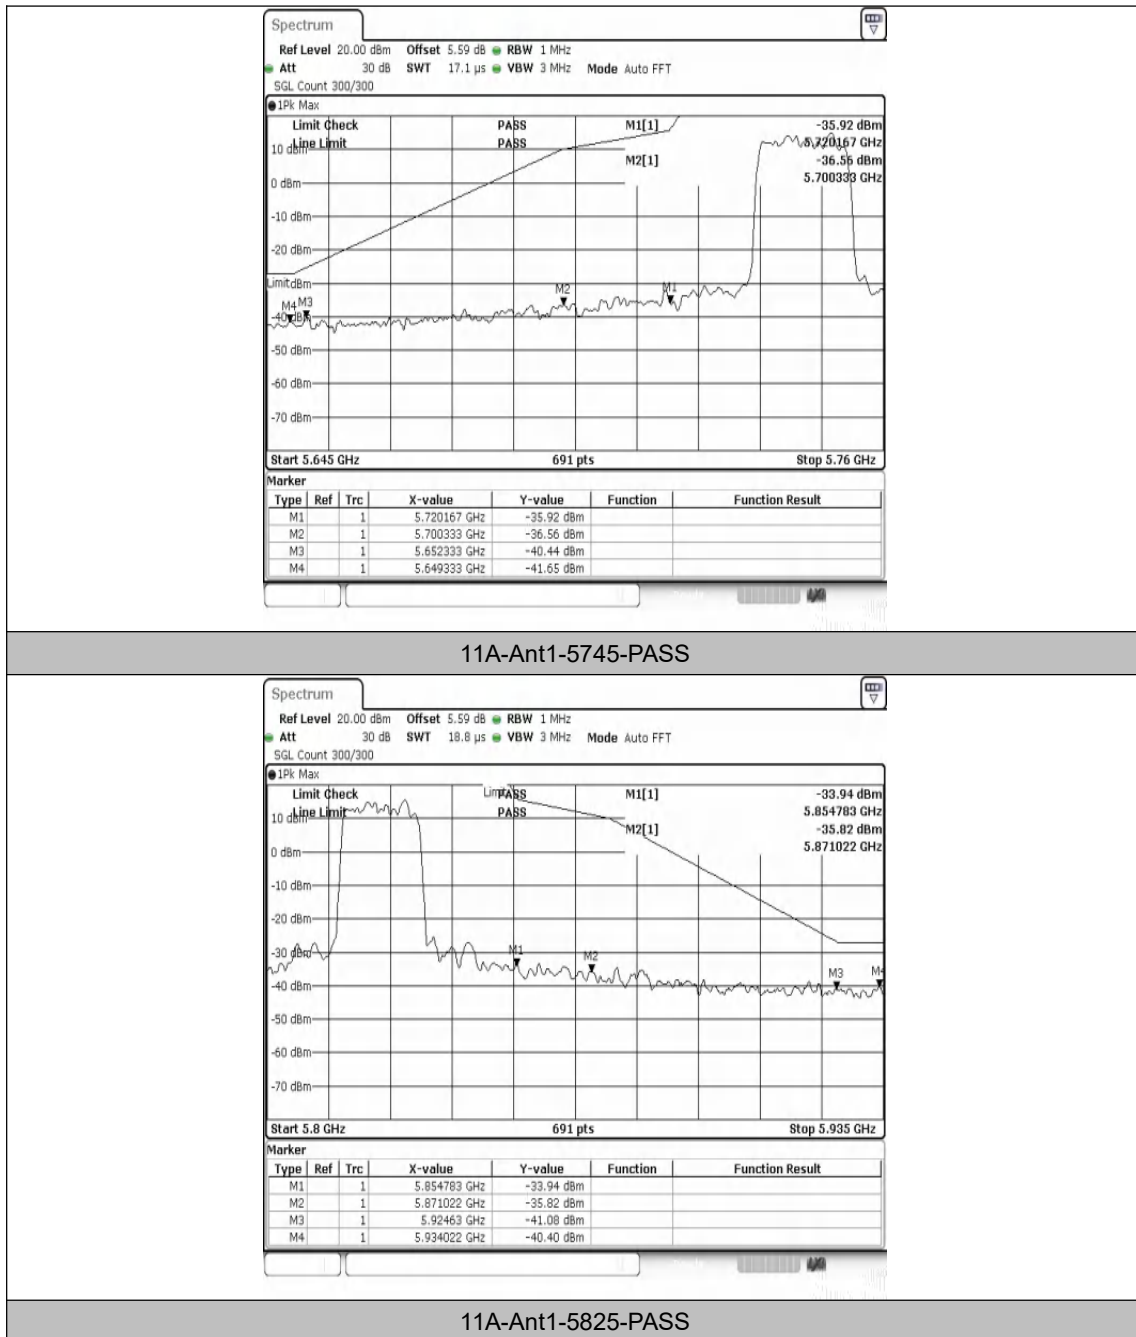

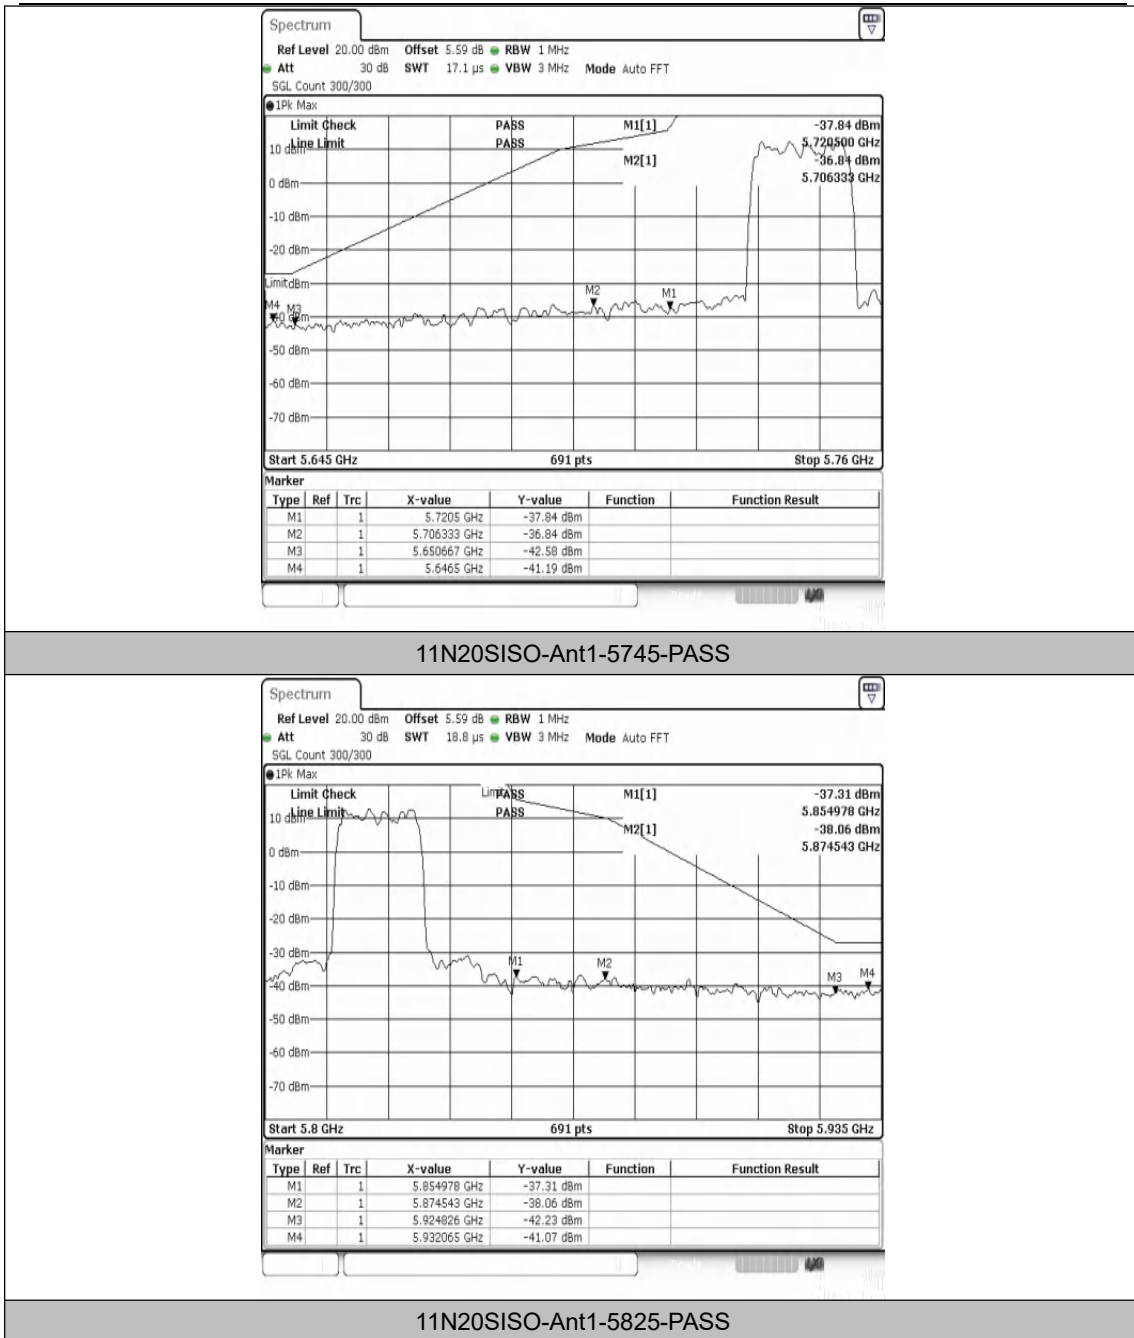


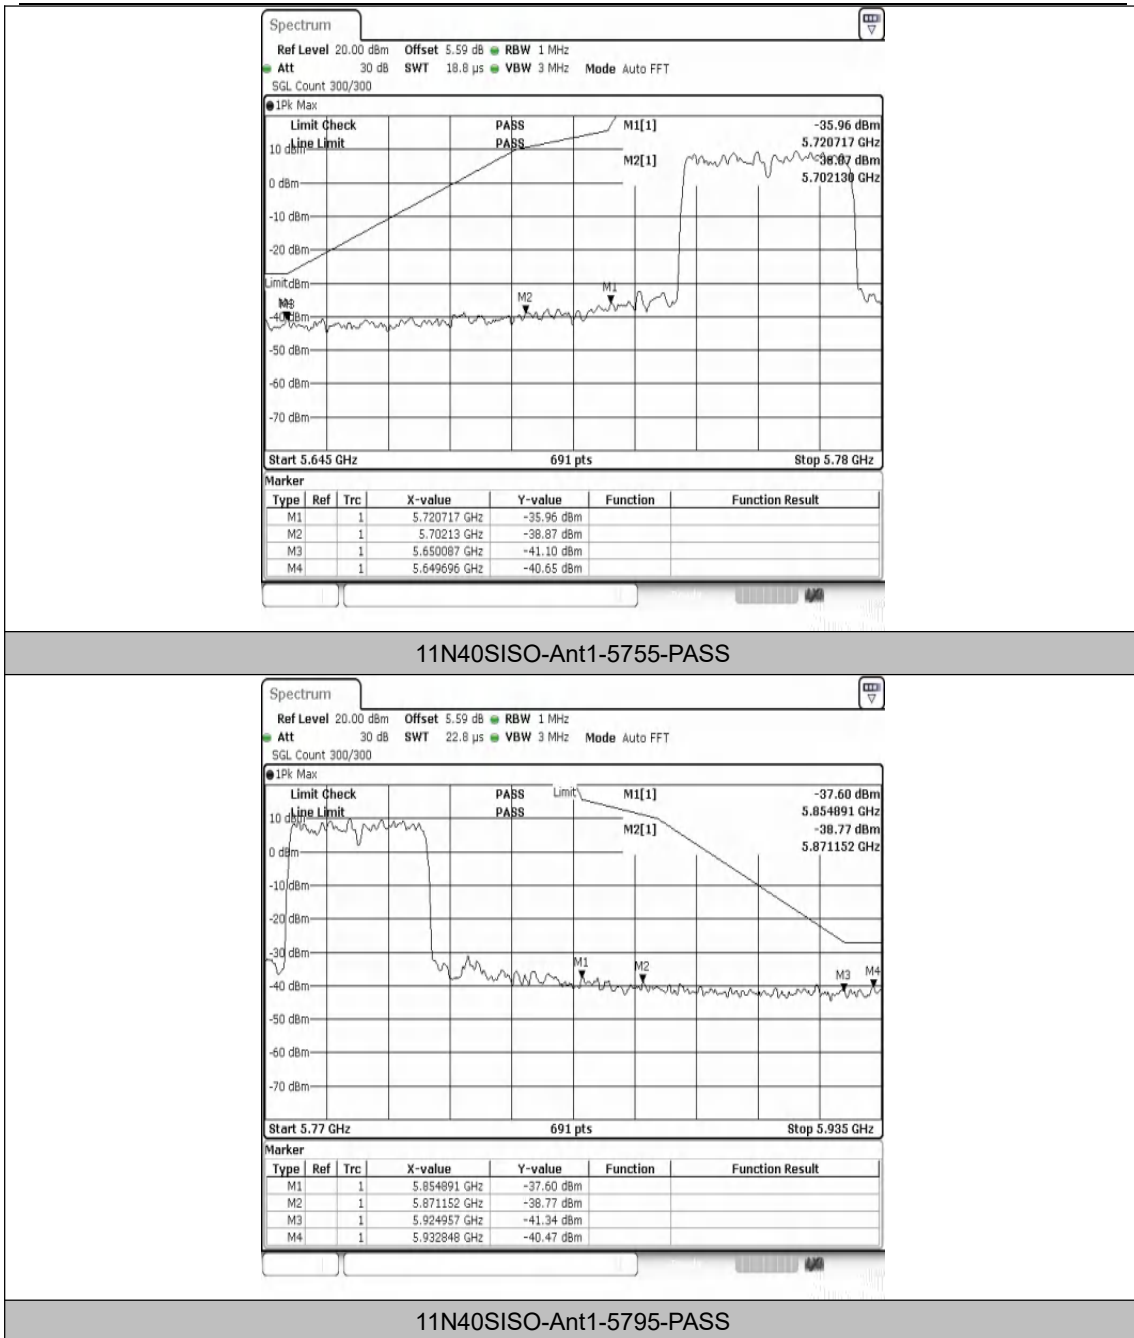

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

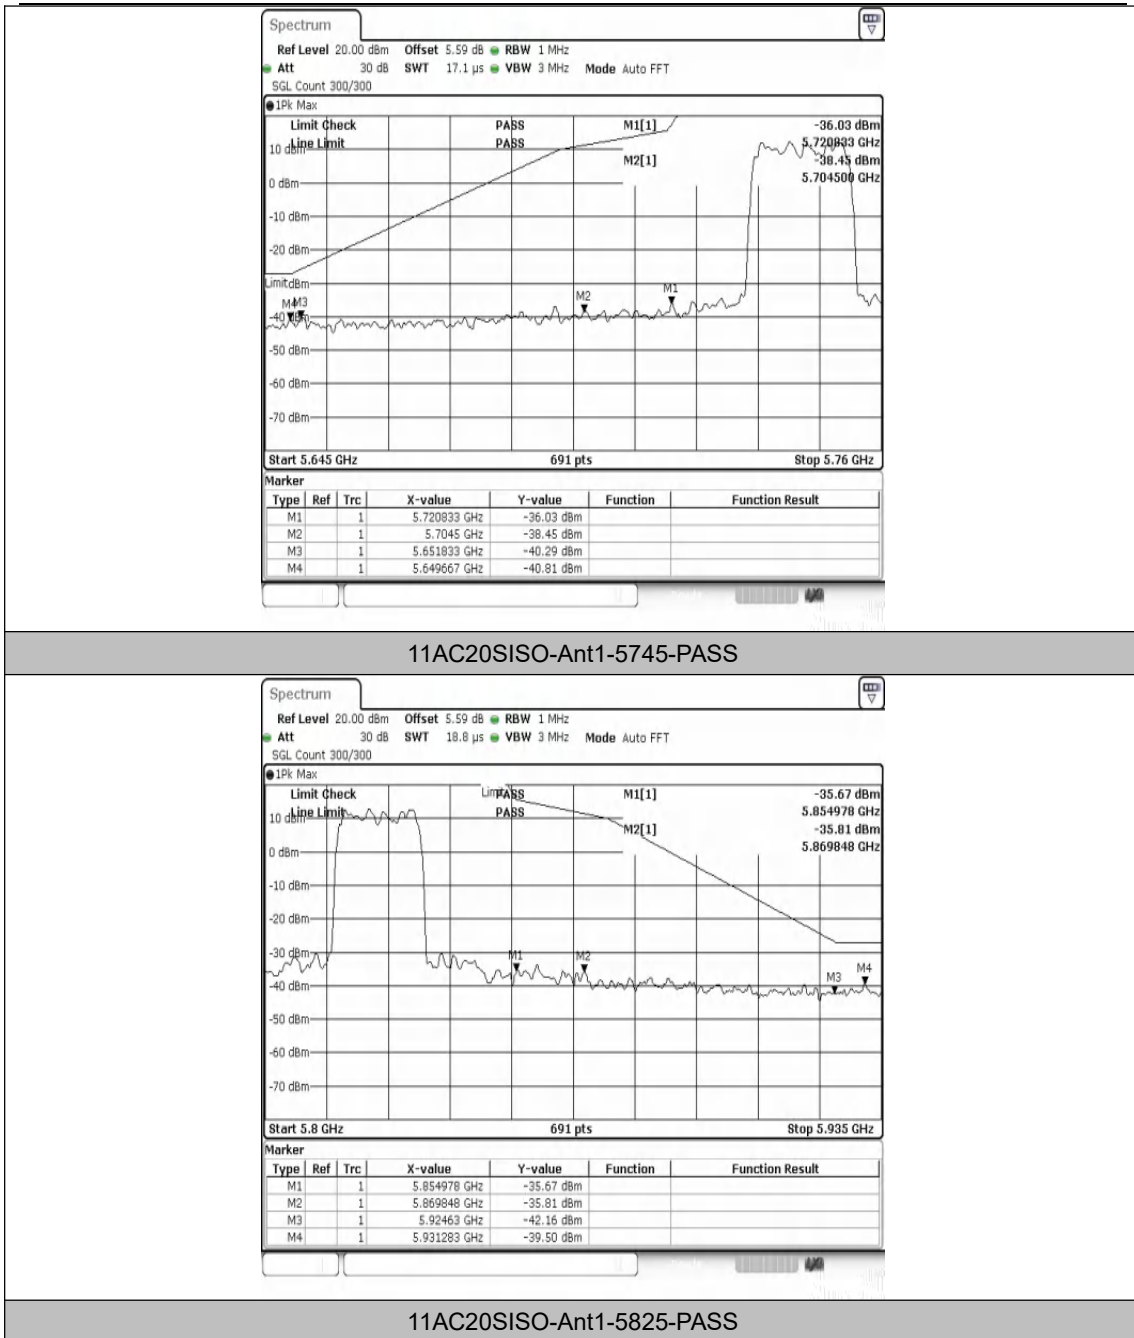



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

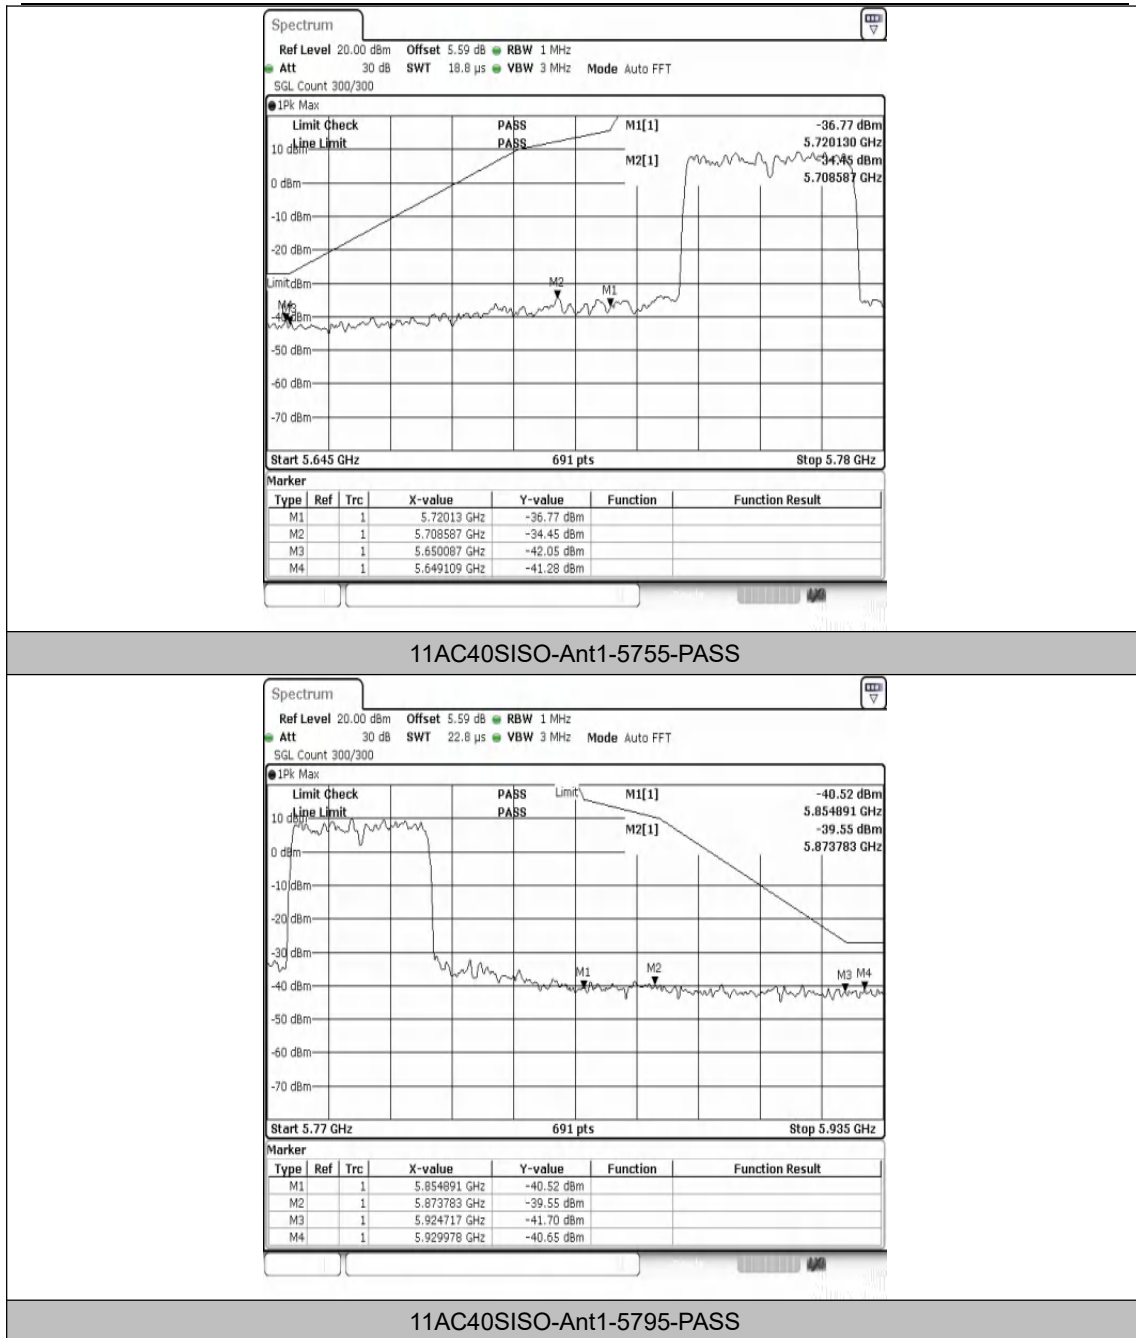

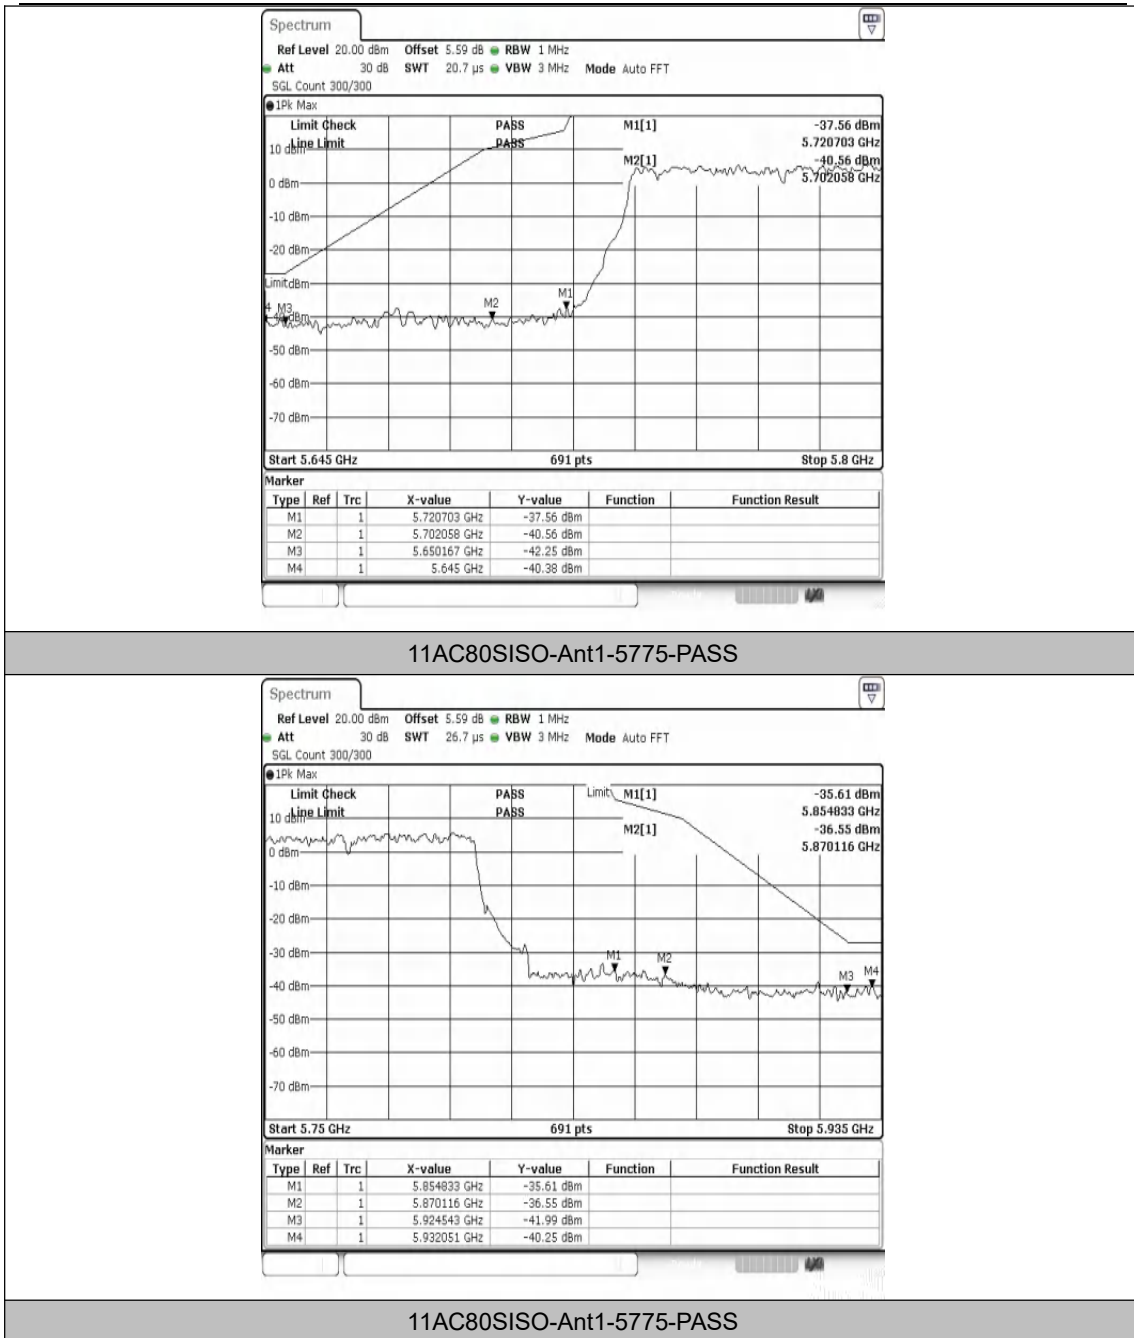


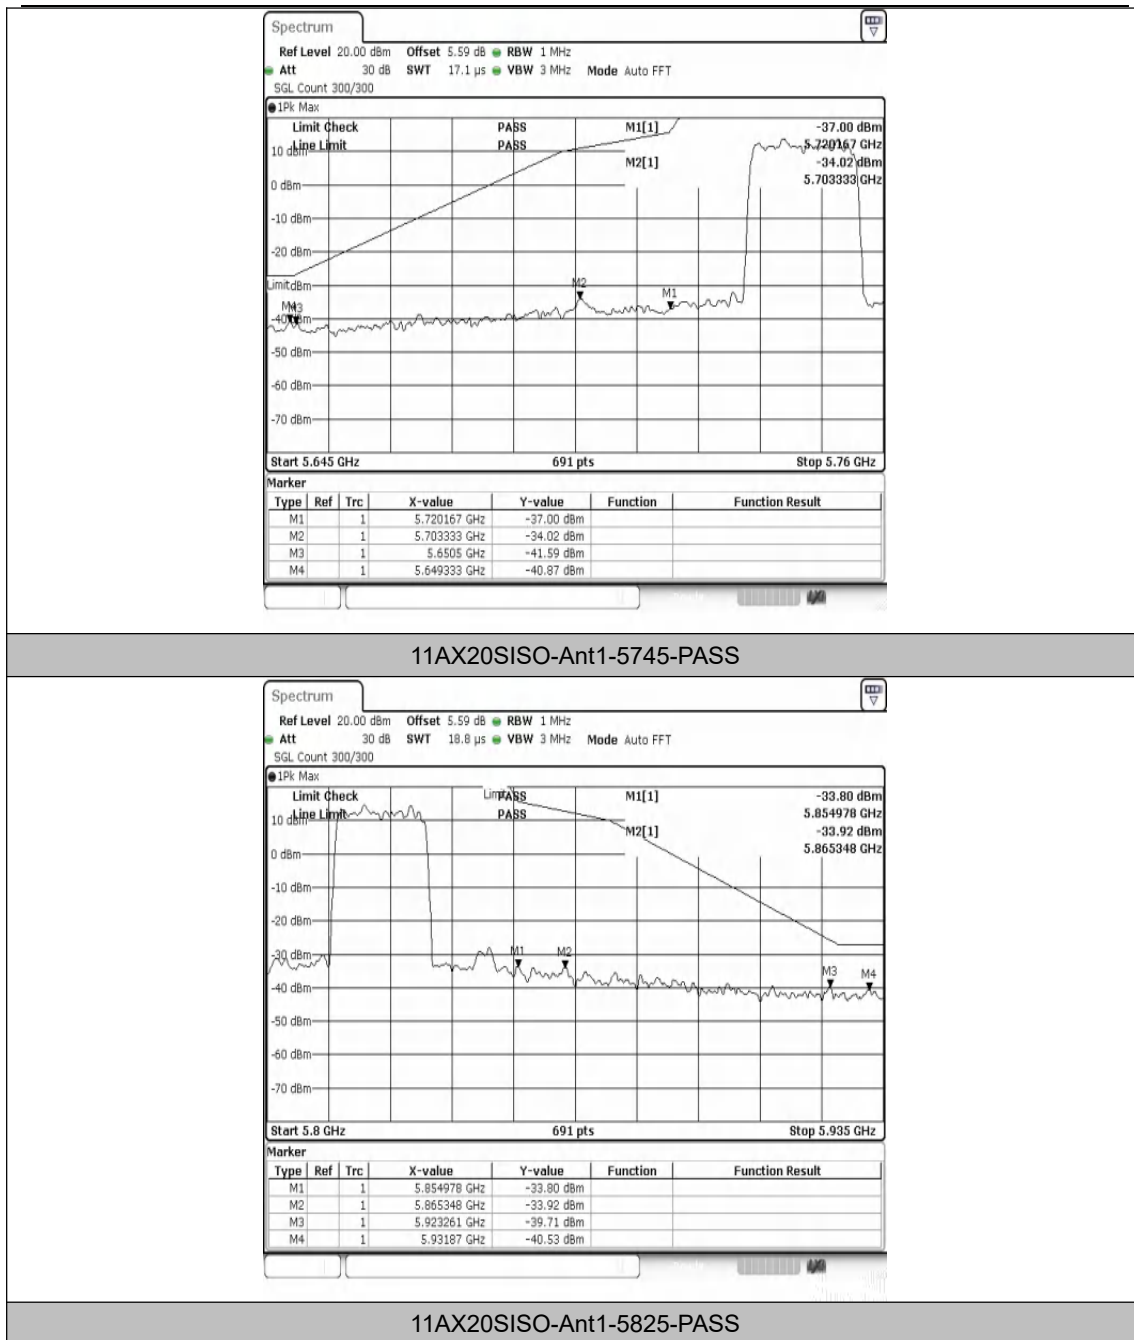

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

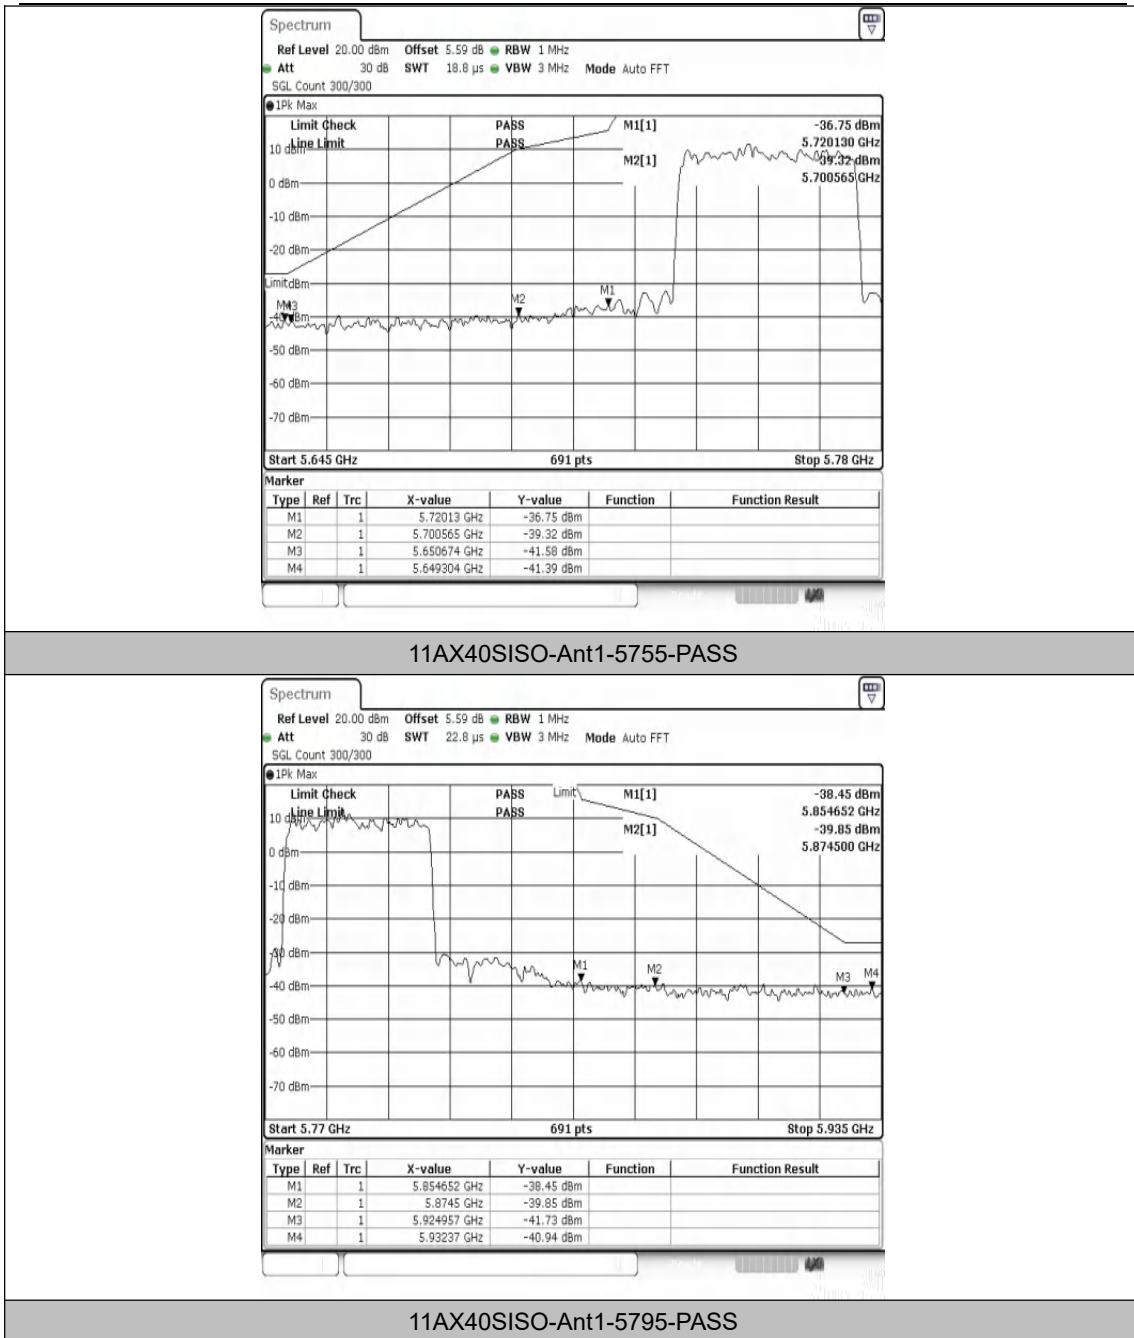

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

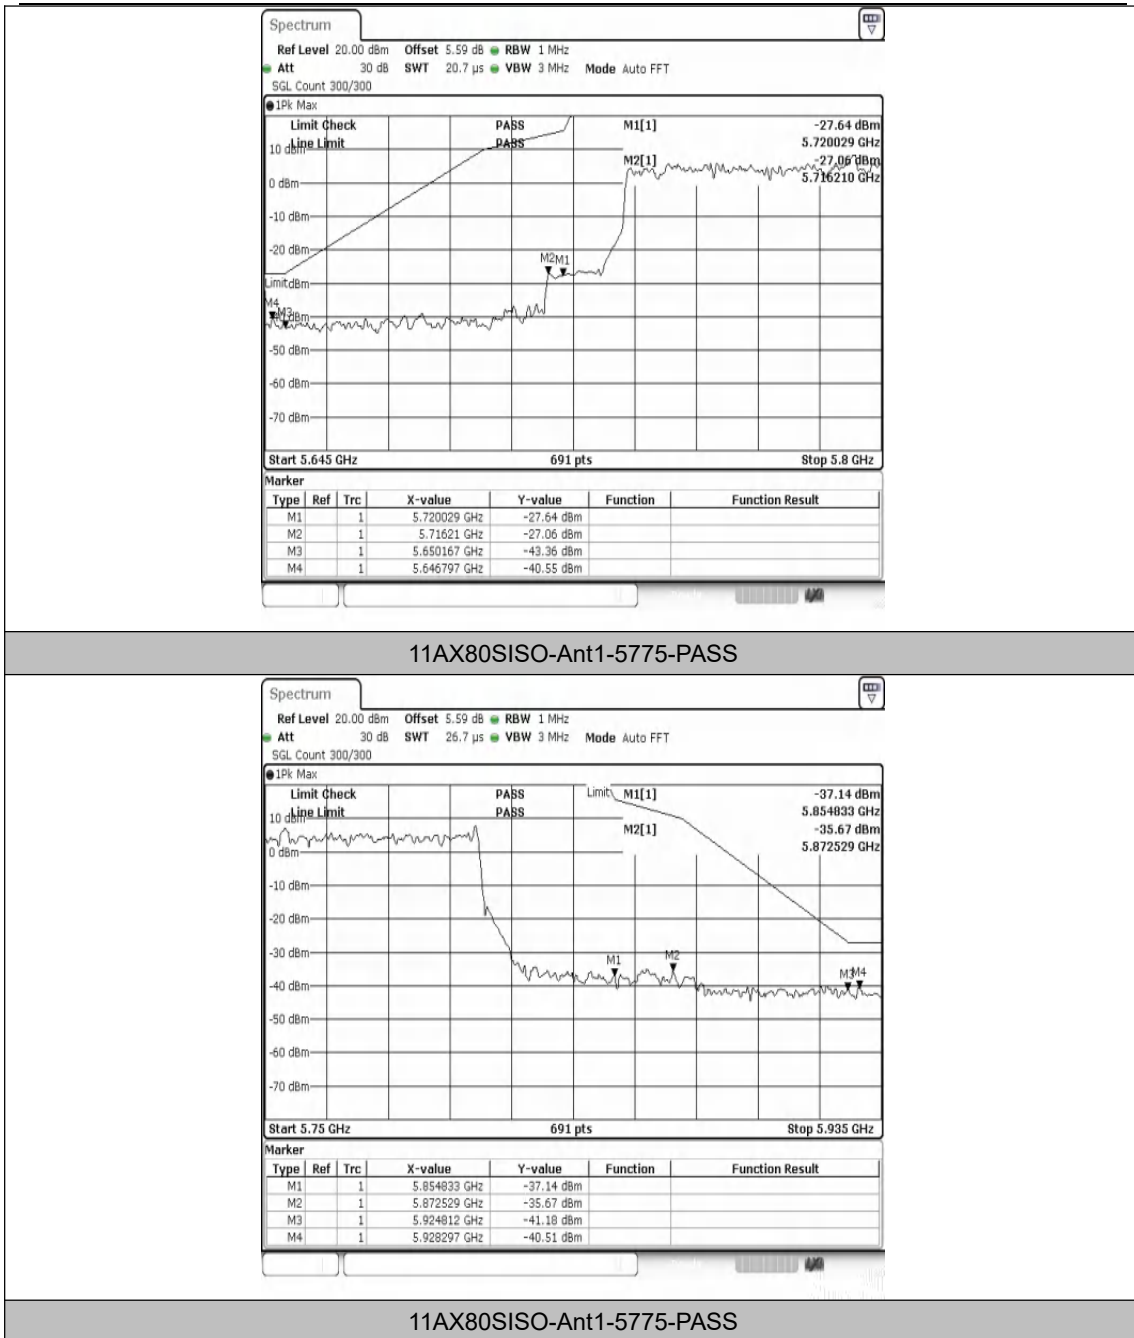

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: DFS Detection Thresholds

Test Result

TestMode	Frequency[dBm]	Radar Type	Result	Limit[dbm]	Verdict
11AC80	5290	Type0	-62.08	-62.00	PASS
	5530	Type0	-62.27	-62.00	PASS

Test Graphs

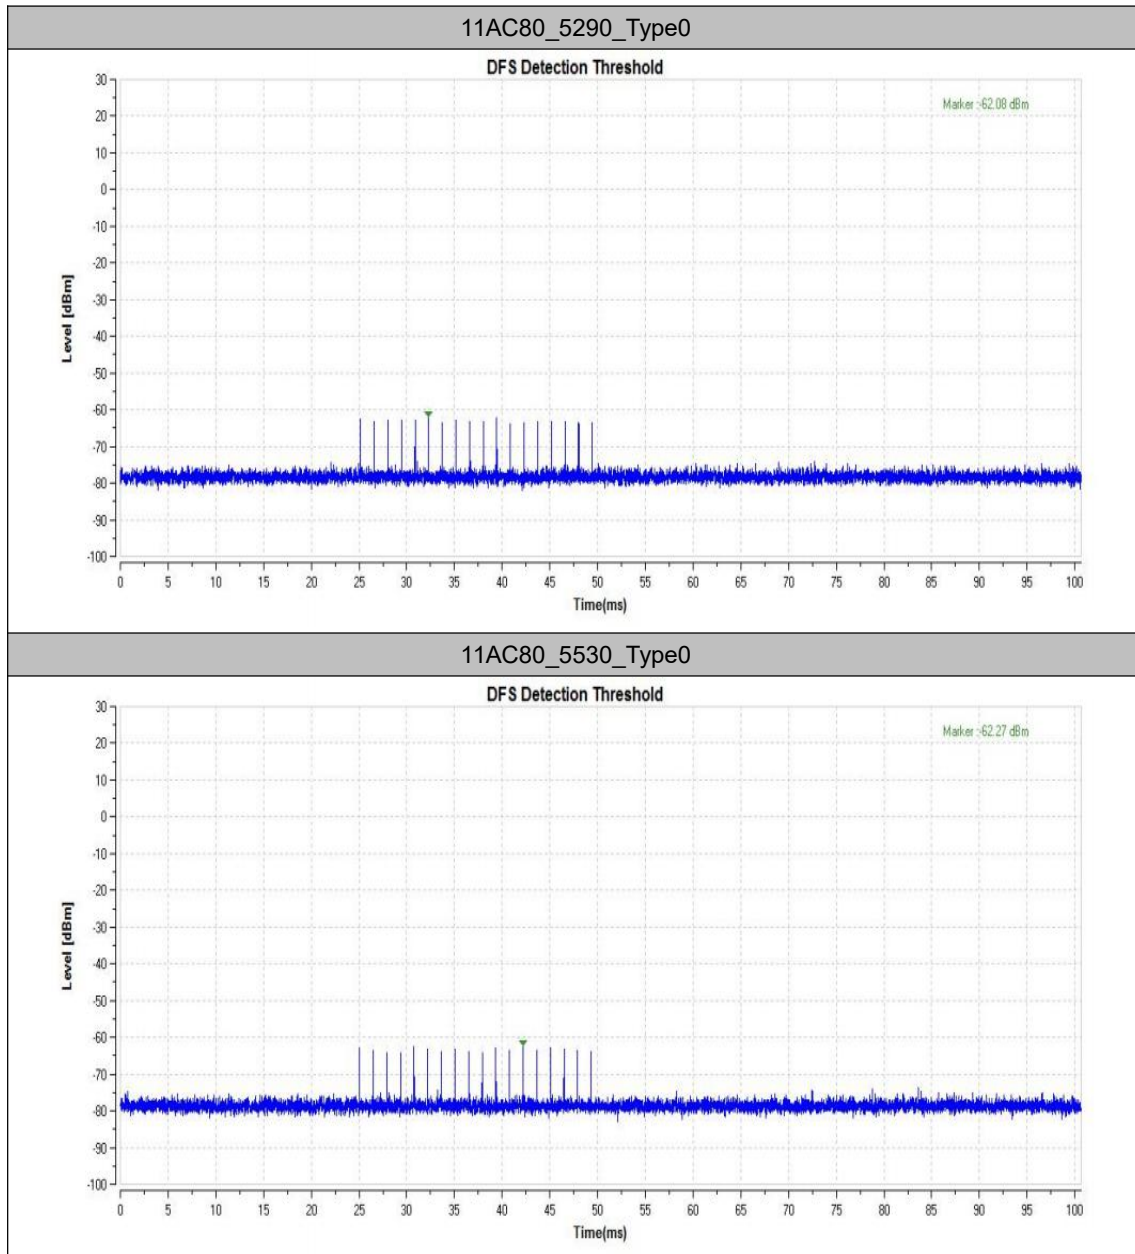

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix G: Channel Loading

Test Result

TestMode	Frequency[MHz]	Result	Limit [%]	Verdict
11AC80	5290	50.76	17	PASS
	5530	58.57	17	PASS

Test Graphs

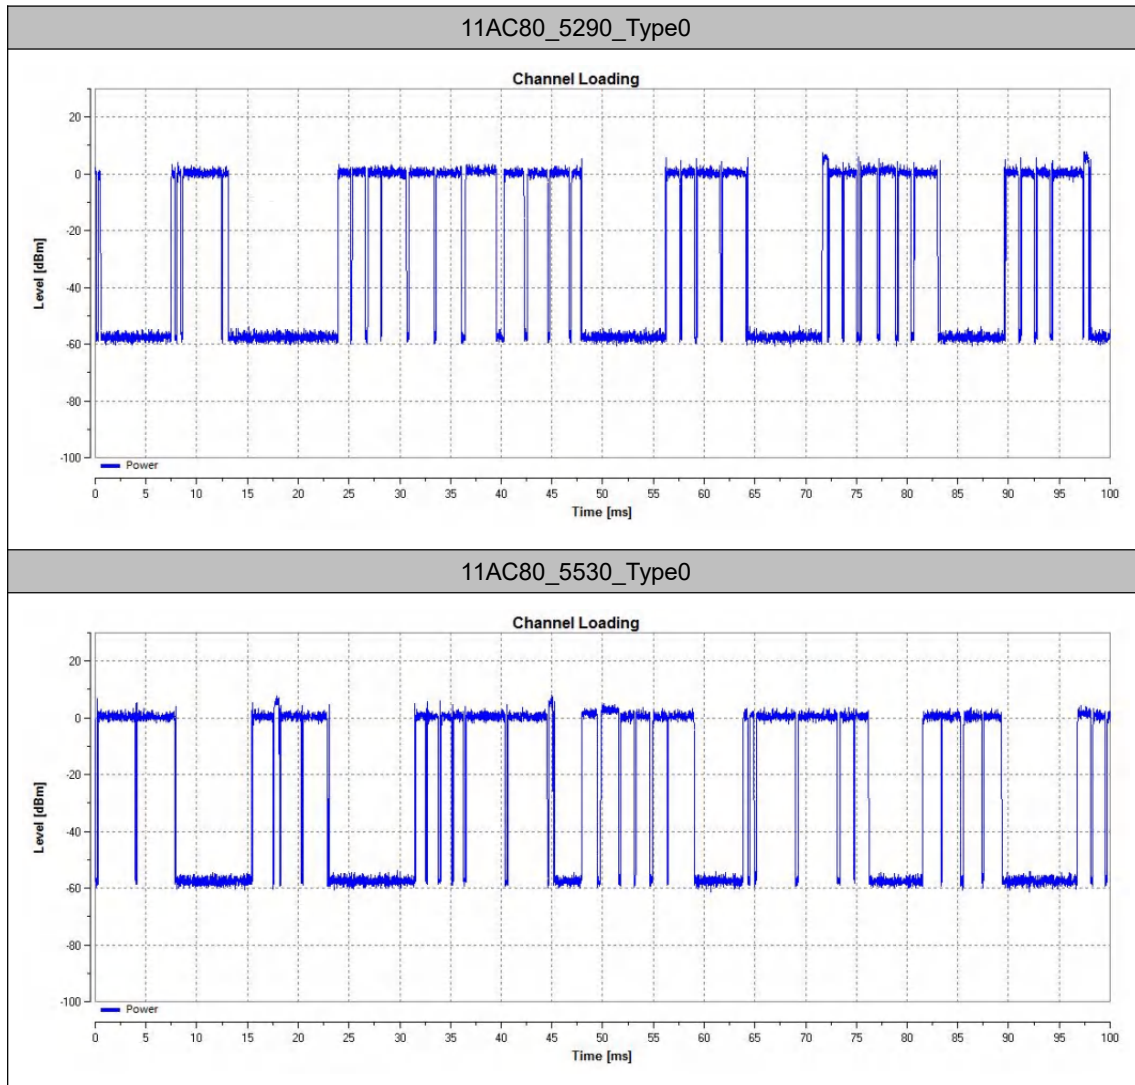

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix H: Channel Move Time and Channel Closing

Transmission Time

Test Result

TestMode	Frequency[MHz]	CCTT[ms]	Limit[ms]	CMT[ms]	Limit[ms]	Verdict
11AC80	5290	200+0	200+60	220.5	10000	PASS
	5530	200+3.9	200+60	205.1	10000	PASS

Test Graphs

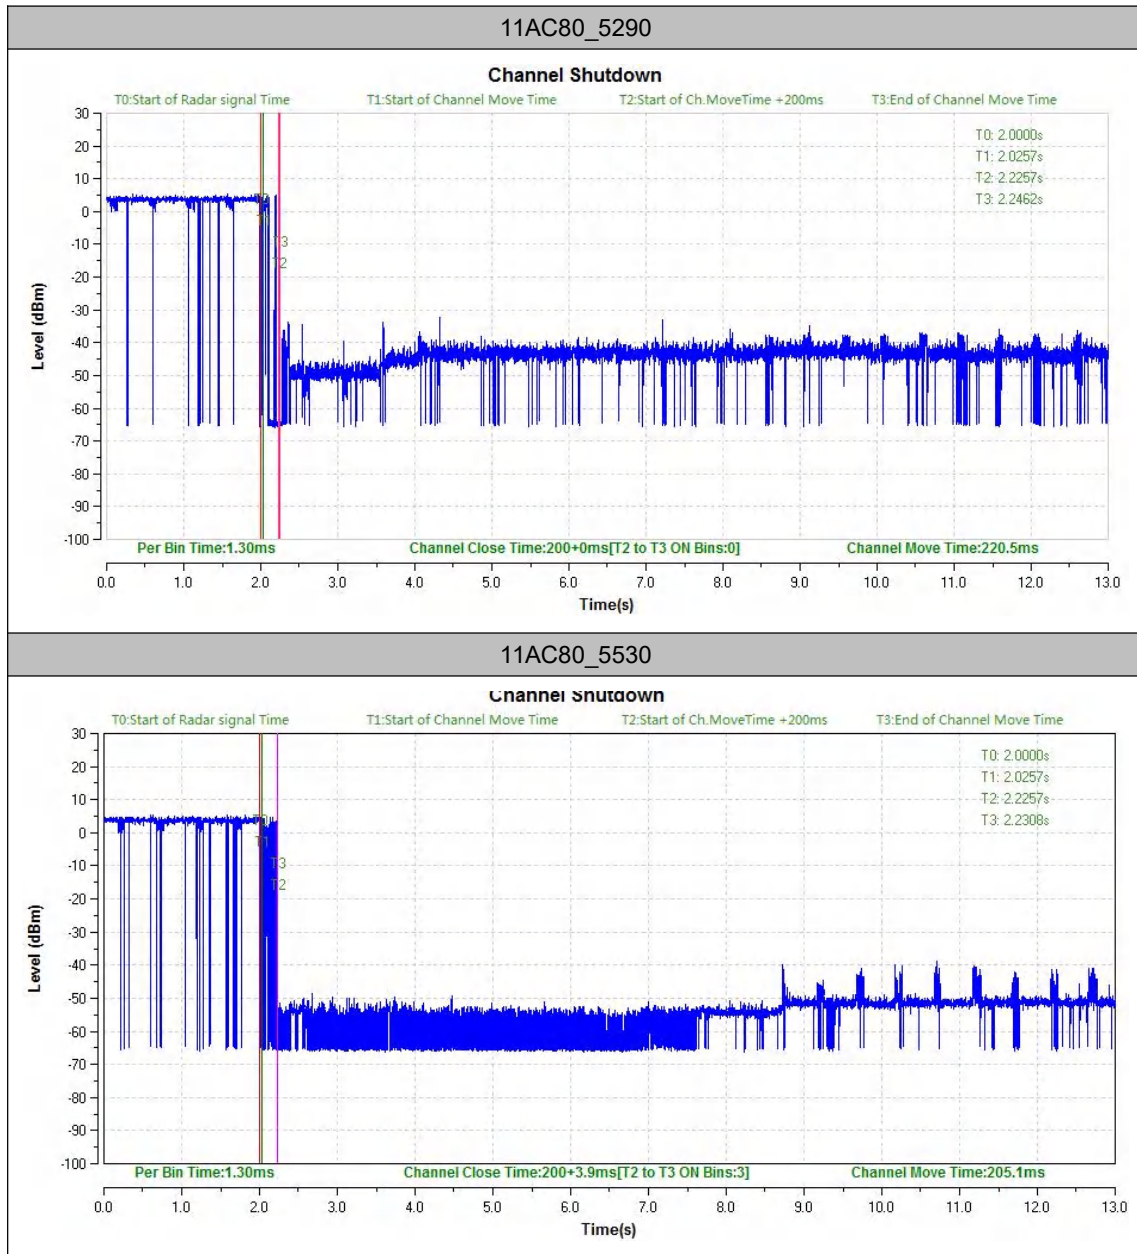

---End---