




10MHz_High_QPSK_1@0(30MHz~1GHz)

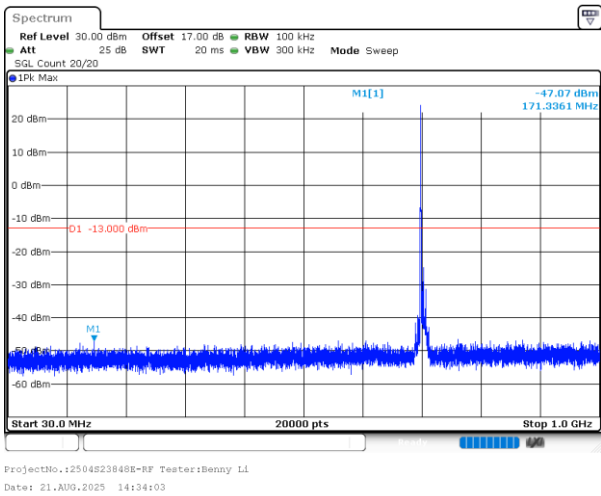


10MHz_High_QPSK_1@0(1GHz~8.16GHz)

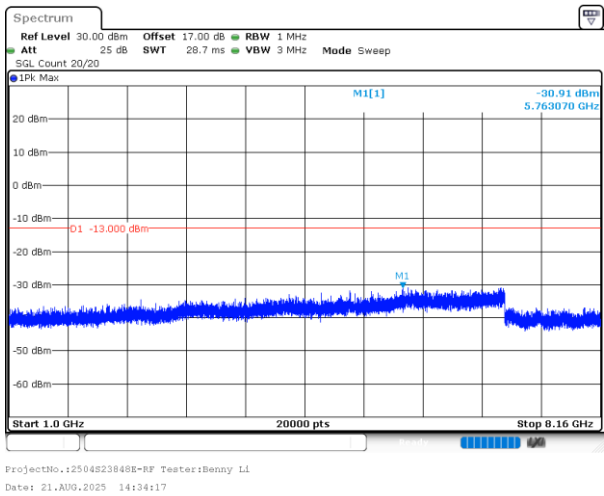

10MHz_High_QPSK_50@0(30MHz~1GHz)

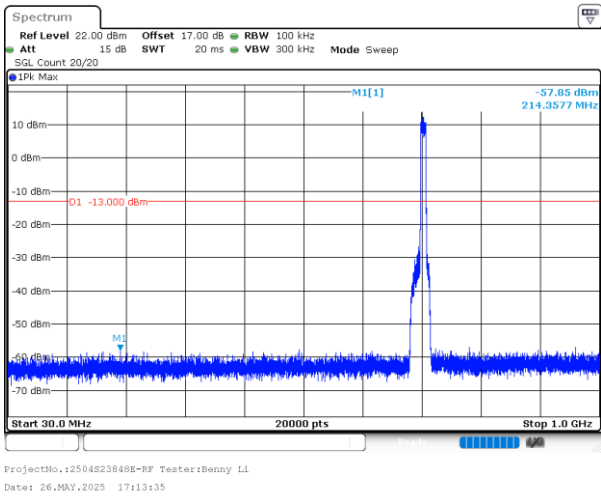


10MHz_High_QPSK_50@0(1GHz~8.16GHz)

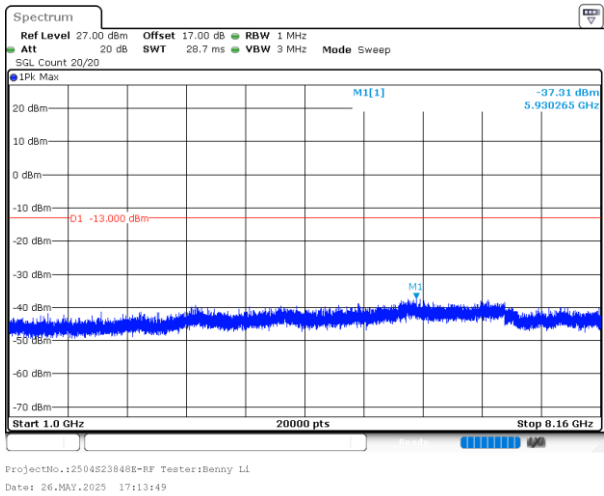


LTE Band 13, Normal
1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~1GHz)

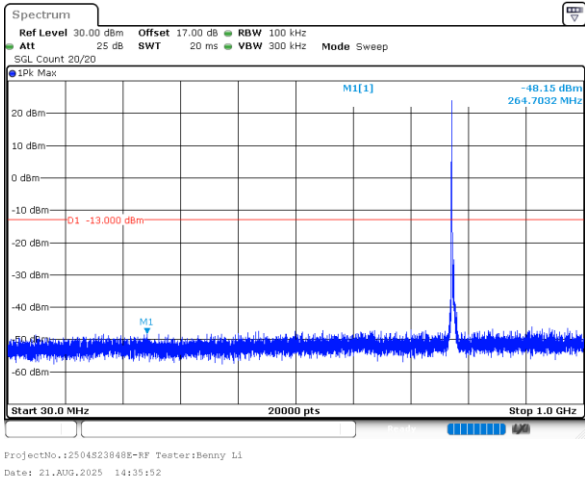

5MHz_Low_QPSK_1@0(763MHz~775MHz)

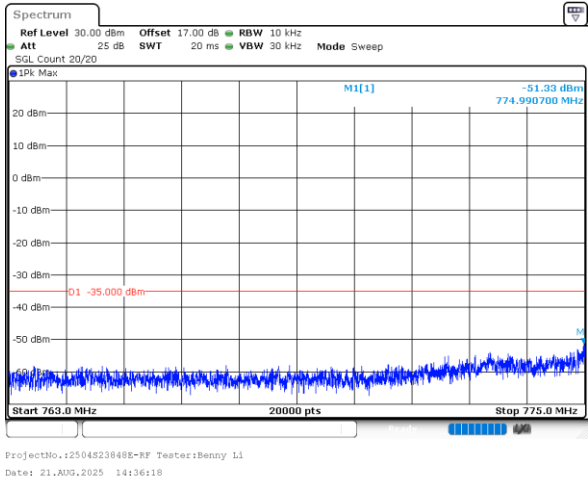


5MHz_Low_QPSK_1@0(793MHz~806MHz)

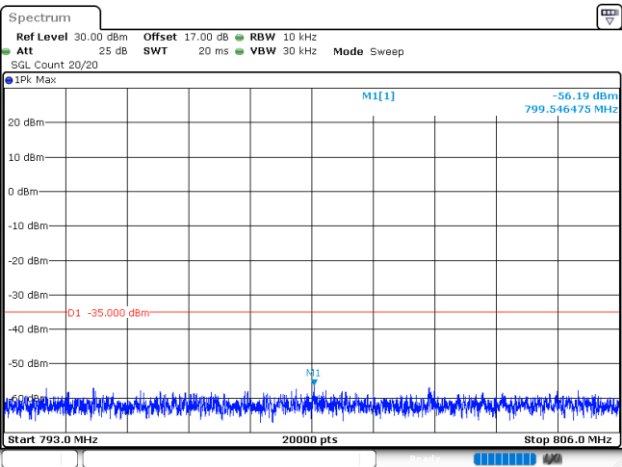


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:36:31

5MHz_Low_QPSK_1@0(1GHz~8.87GHz)

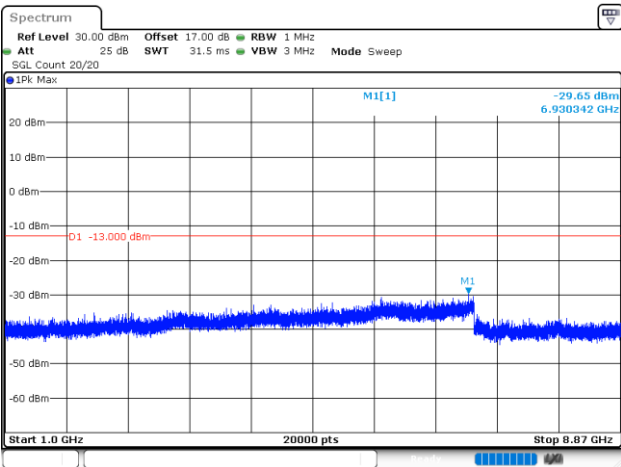


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:36:05

5MHz_Low_QPSK_1@0(1559MHz~1610MHz)

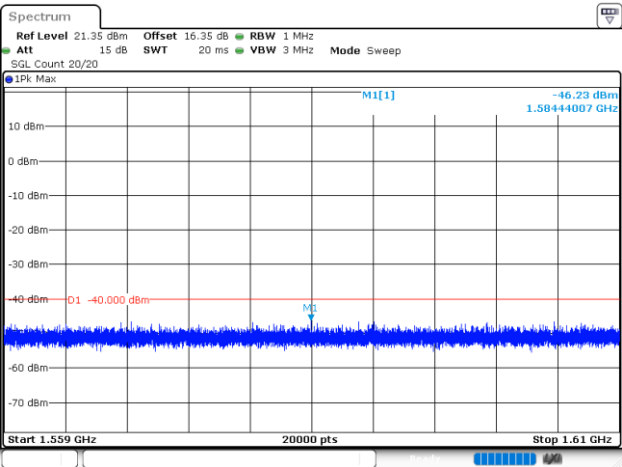


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:48:17

5MHz_Low_QPSK_25@0(30MHz~1GHz)

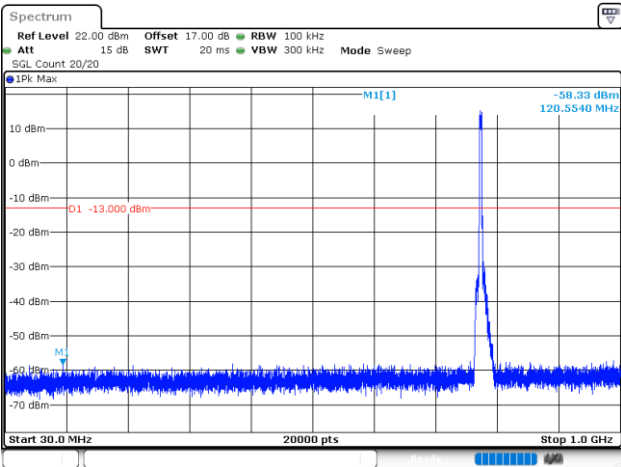


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 17:59:11

5MHz_Low_QPSK_25@0(763MHz~775MHz)

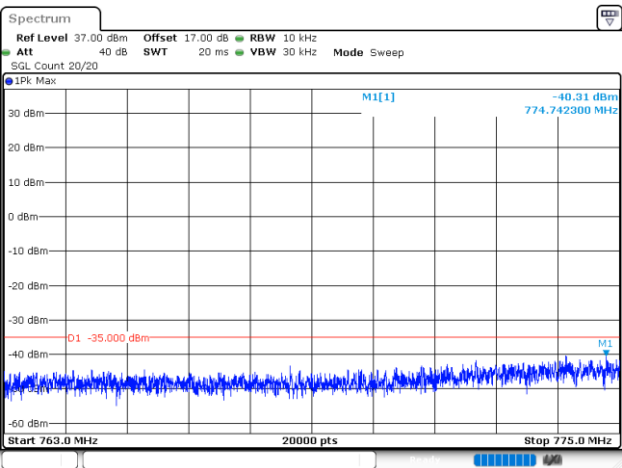


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 17:59:26

5MHz_Low_QPSK_25@0(793MHz~806MHz)

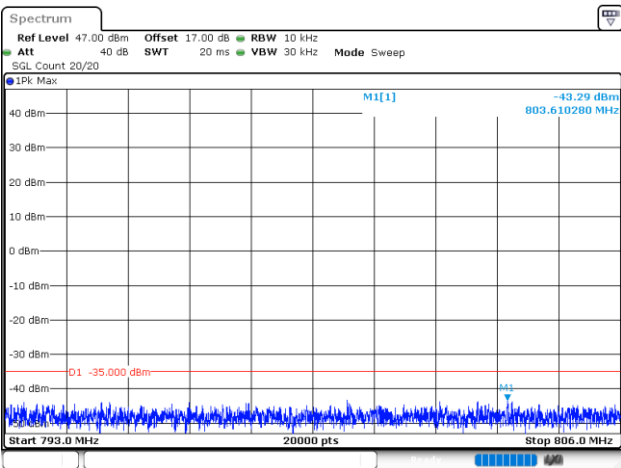


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 17:59:32

5MHz_Low_QPSK_25@0(1GHz~8.87GHz)

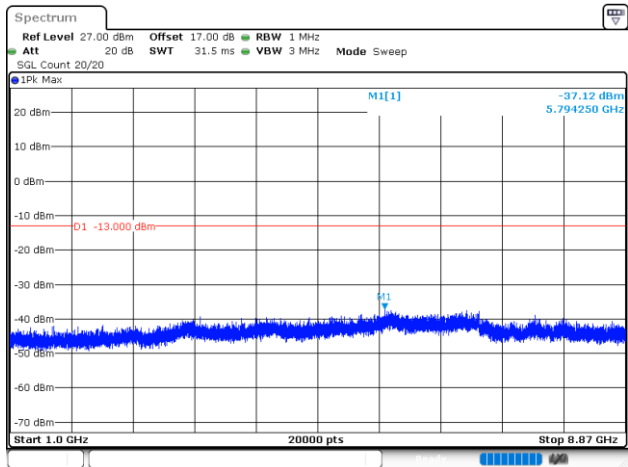


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 17:59:20

5MHz_Low_QPSK_25@0(1559MHz~1610MHz)

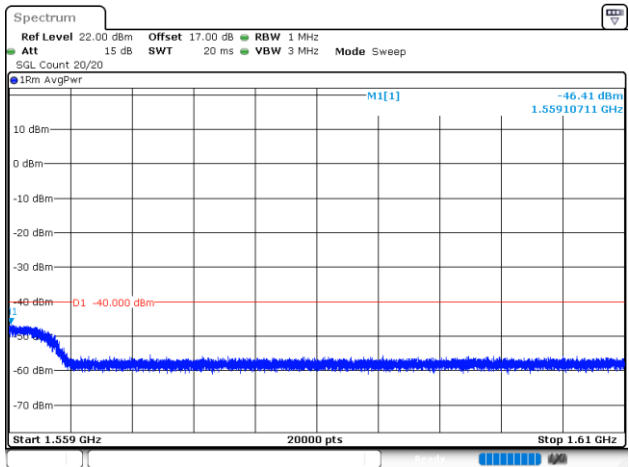


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 17:59:40

5MHz_High_QPSK_1@0(30MHz~1GHz)

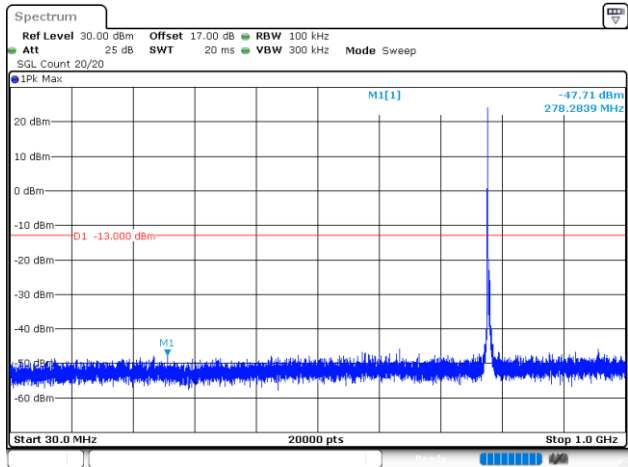


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:37:05

5MHz_High_QPSK_1@0(763MHz~775MHz)

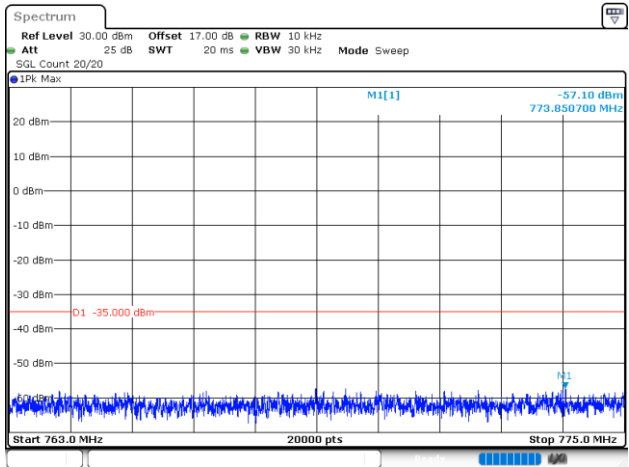


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:37:32

5MHz_High_QPSK_1@0(793MHz~806MHz)

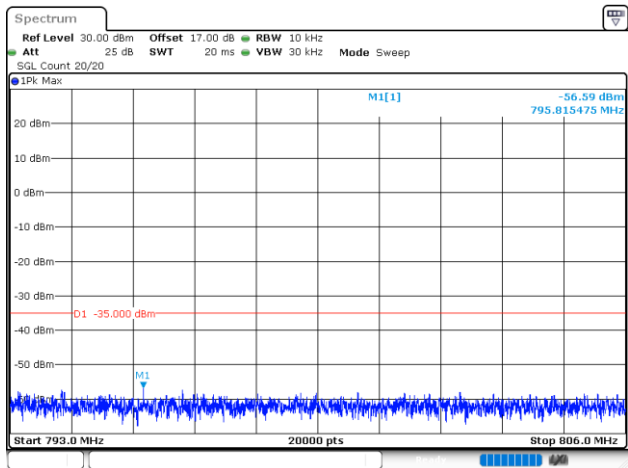


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:37:44

5MHz_High_QPSK_1@0(1GHz~8.87GHz)

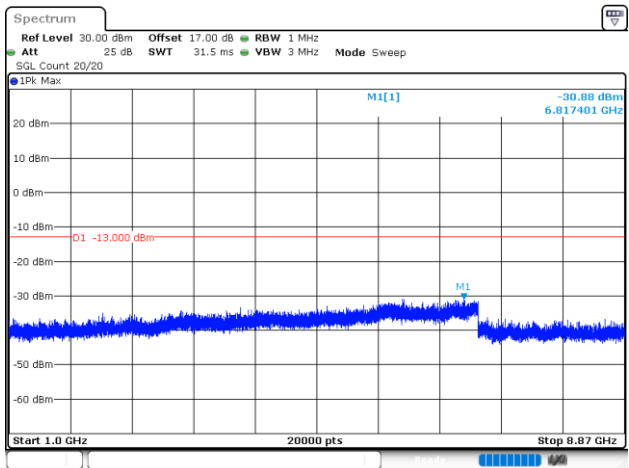


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:37:20

5MHz_High_QPSK_1@0(1559MHz~1610MHz)

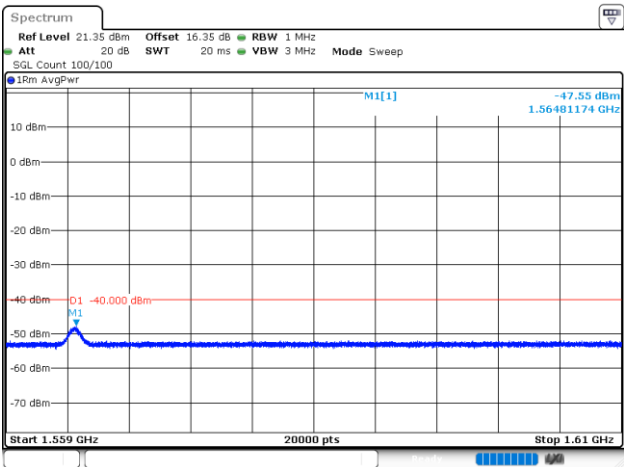


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:53:33

5MHz_High_QPSK_25@0(30MHz~1GHz)

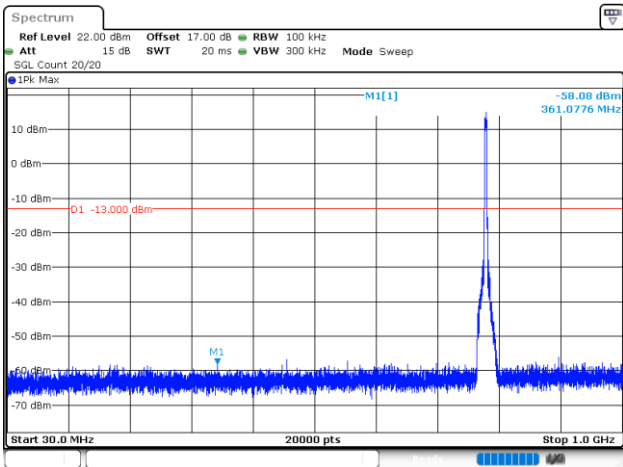


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:00:52

5MHz_High_QPSK_25@0(763MHz~775MHz)

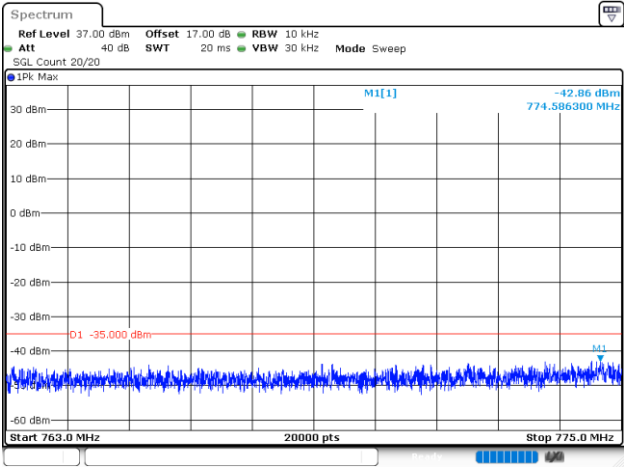


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:01:09

5MHz_High_QPSK_25@0(793MHz~806MHz)

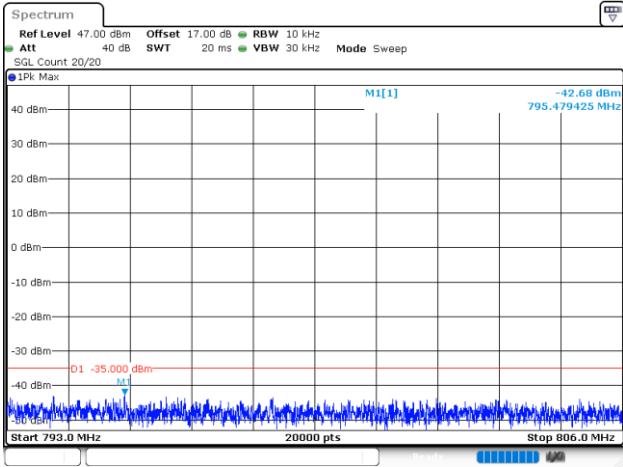


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:01:17

5MHz_High_QPSK_25@0(1GHz~8.87GHz)

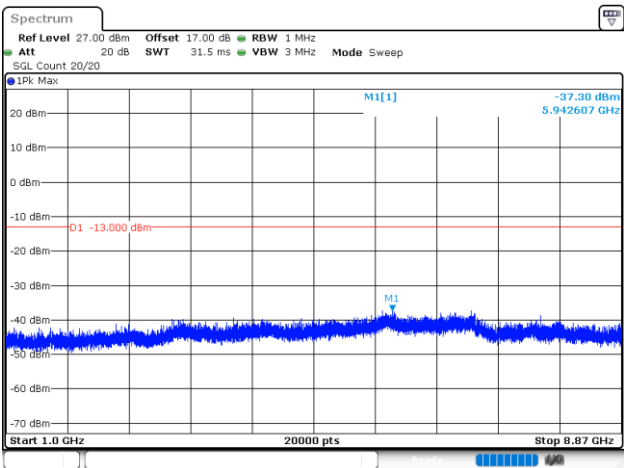


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:01:01

5MHz_High_QPSK_25@0(1559MHz~1610MHz)

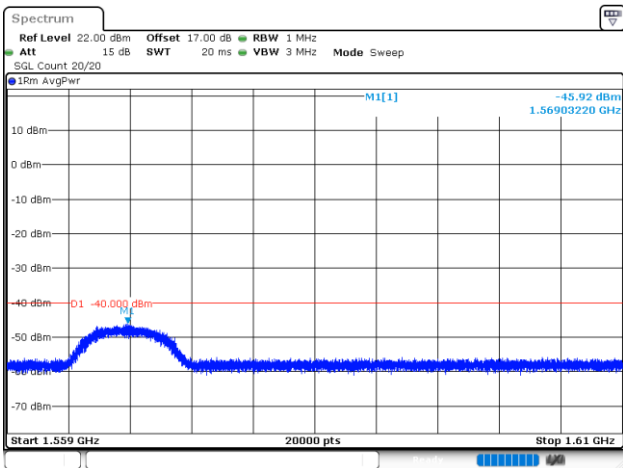


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:01:25

10MHz_Middle_QPSK_1@0(30MHz~1GHz)

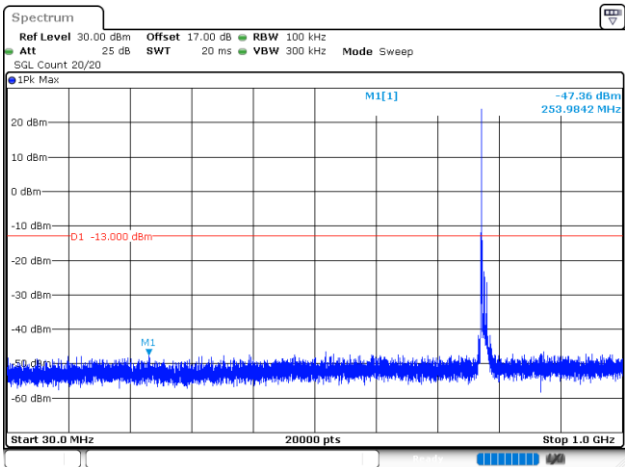


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:39:17

10MHz_Middle_QPSK_1@0(763MHz~775MHz)

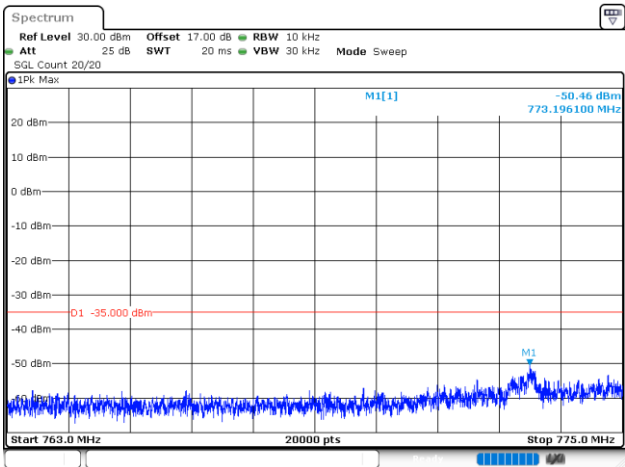


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:39:44

10MHz_Middle_QPSK_1@0(793MHz~806MHz)

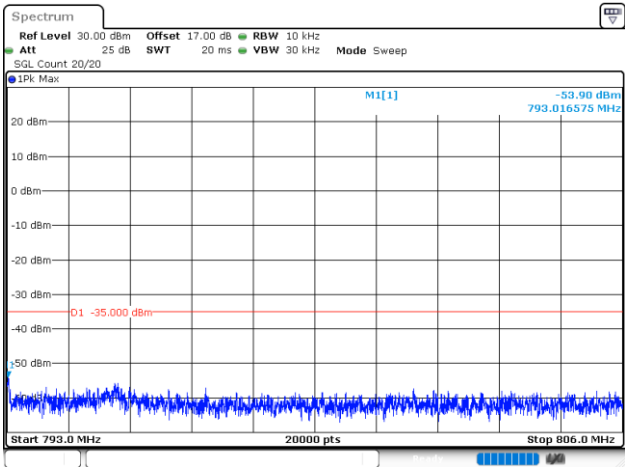


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:39:56

10MHz_Middle_QPSK_1@0(1GHz~8.87GHz)

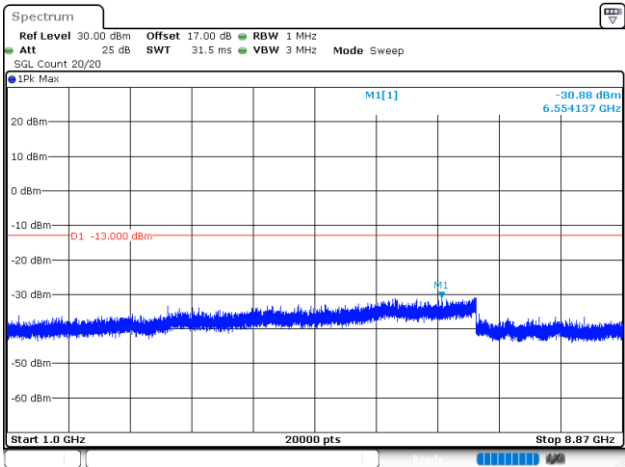


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:39:31

10MHz_Middle_QPSK_1@0(1559MHz~1610MHz)

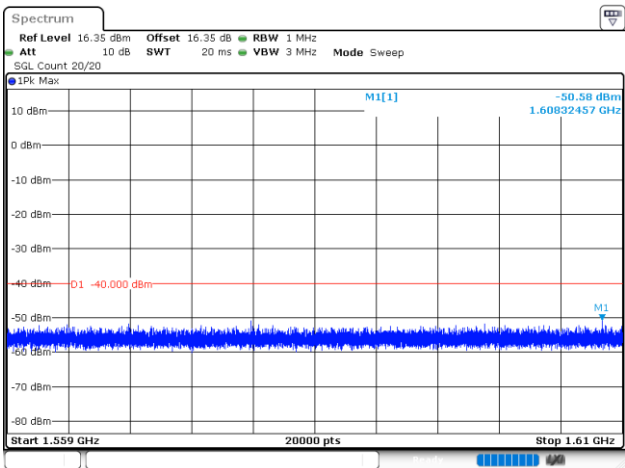


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:50:33

10MHz_Middle_QPSK_50@0(30MHz~1GHz)

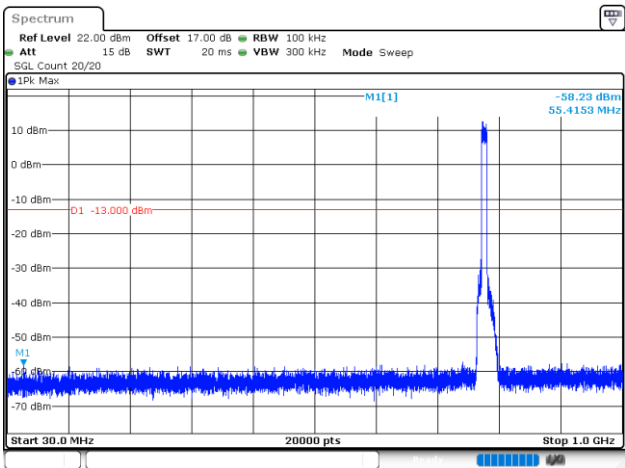


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:03:22


10MHz_Middle_QPSK_50@0(763MHz~775MHz)

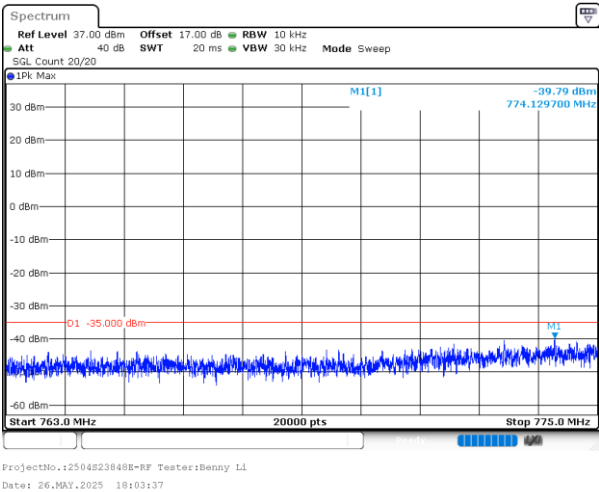


10MHz_Middle_QPSK_50@0(793MHz~806MHz)

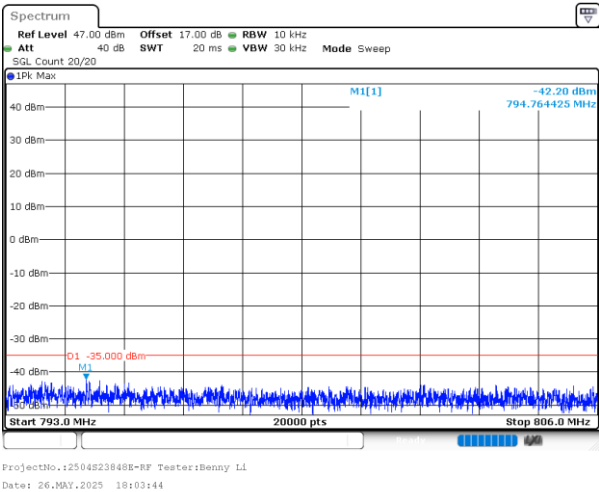

10MHz_Middle_QPSK_50@0(1GHz~8.87GHz)

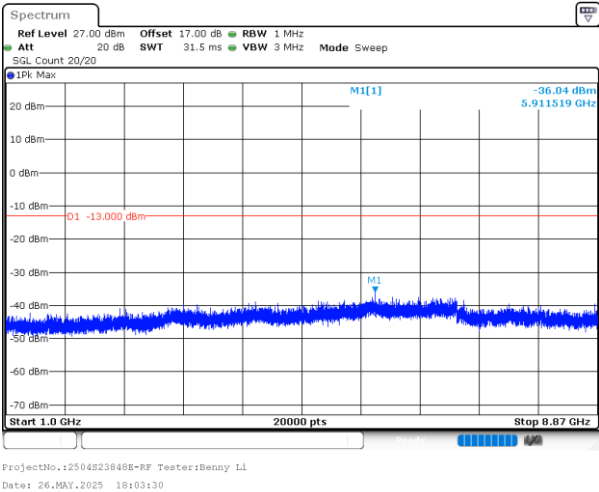


10MHz_Middle_QPSK_50@0(1559MHz~1610MHz)

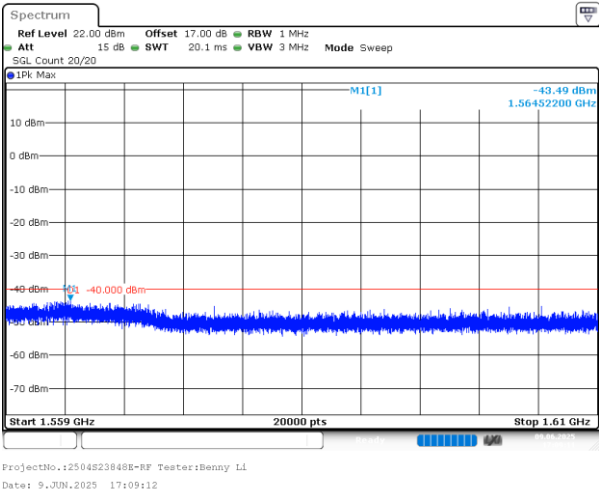


LTE Band 17, Normal
1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~1GHz)

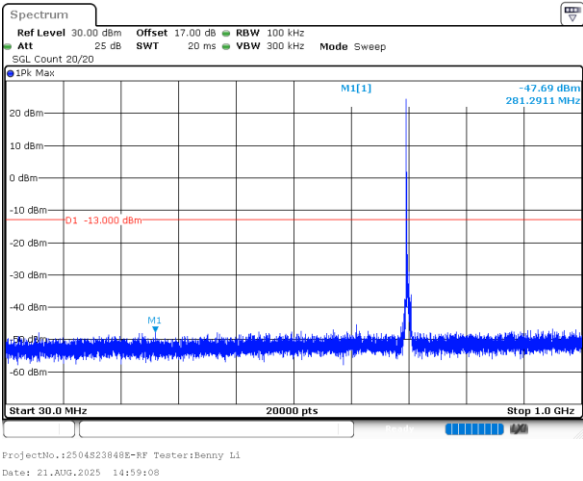

5MHz_Low_QPSK_1@0(1GHz~8.16GHz)

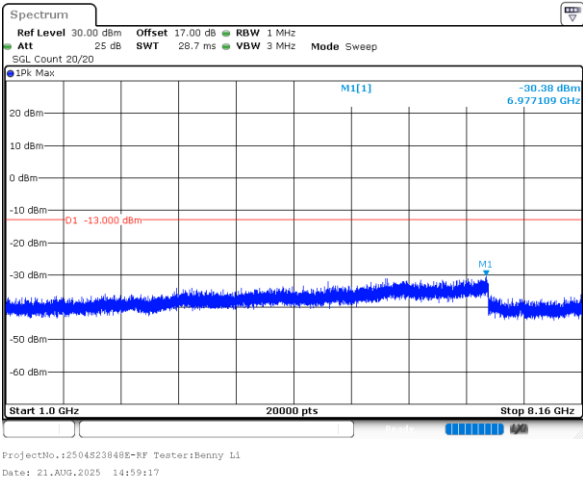


5MHz_Low_QPSK_25@0(30MHz~1GHz)

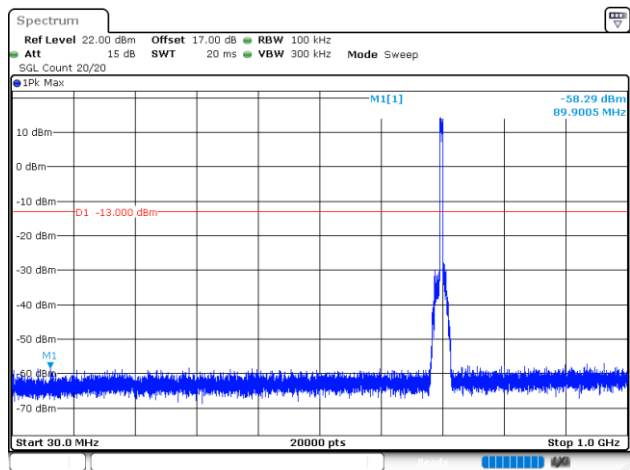


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:05:20

5MHz_Low_QPSK_25@0(1GHz~8.16GHz)

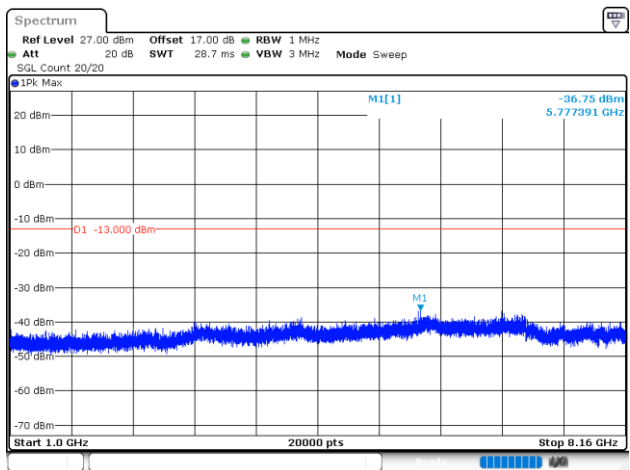


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:05:29

5MHz_Middle_QPSK_1@0(30MHz~1GHz)

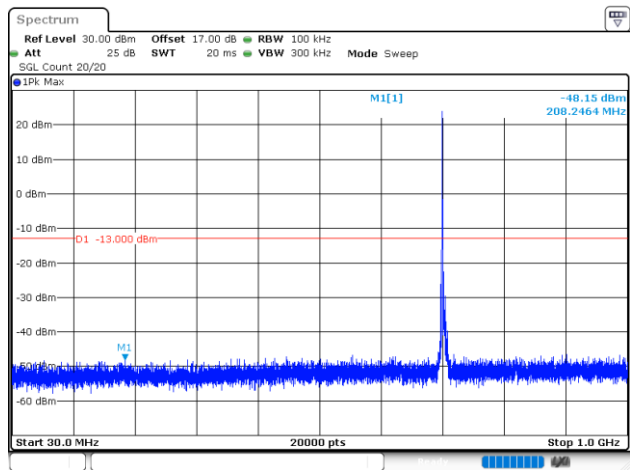


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:59:26

5MHz_Middle_QPSK_1@0(1GHz~8.16GHz)

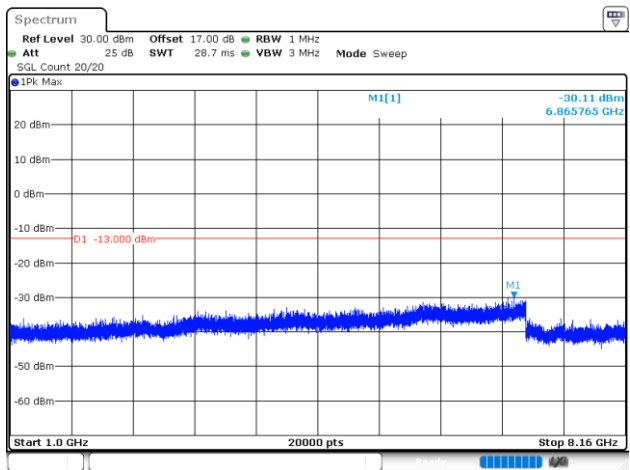


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:59:34

5MHz_Middle_QPSK_25@0(30MHz~1GHz)

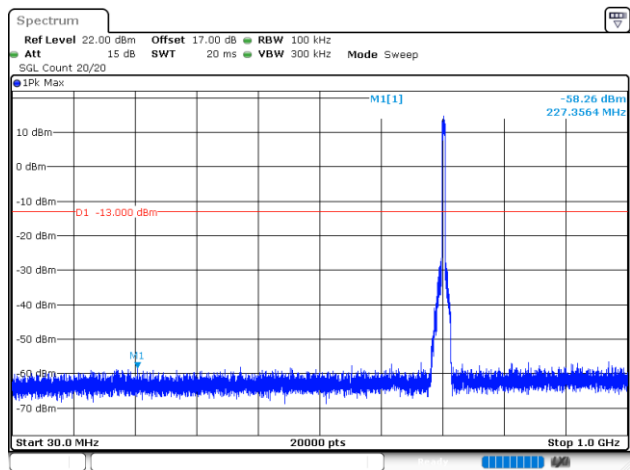


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:06:29

5MHz_Middle_QPSK_25@0(1GHz~8.16GHz)

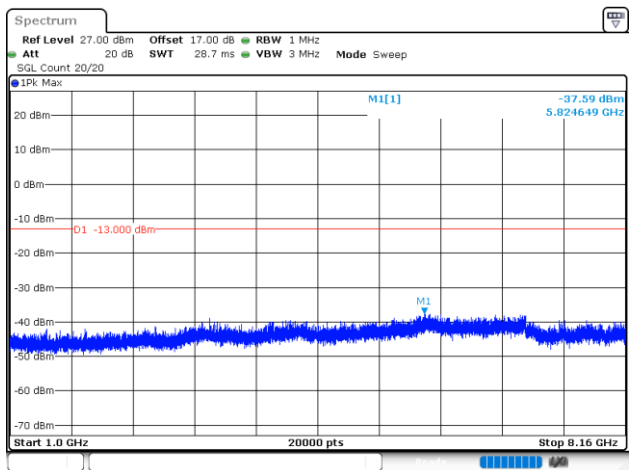


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:06:37

5MHz_High_QPSK_1@0(30MHz~1GHz)

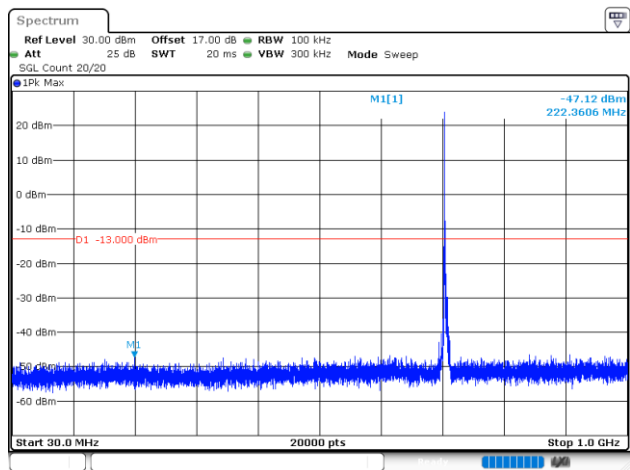


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:59:43

5MHz_High_QPSK_1@0(1GHz~8.16GHz)

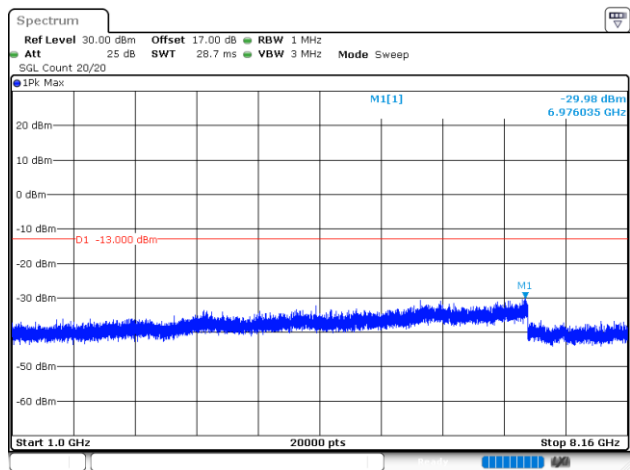


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 14:59:51

5MHz_High_QPSK_25@0(30MHz~1GHz)

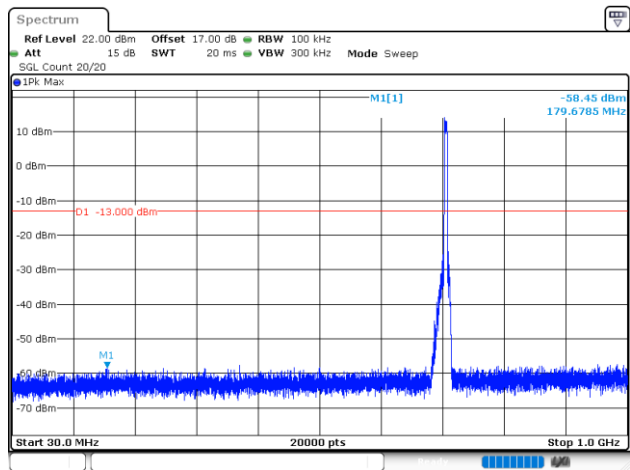


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:07:27

5MHz_High_QPSK_25@0(1GHz~8.16GHz)

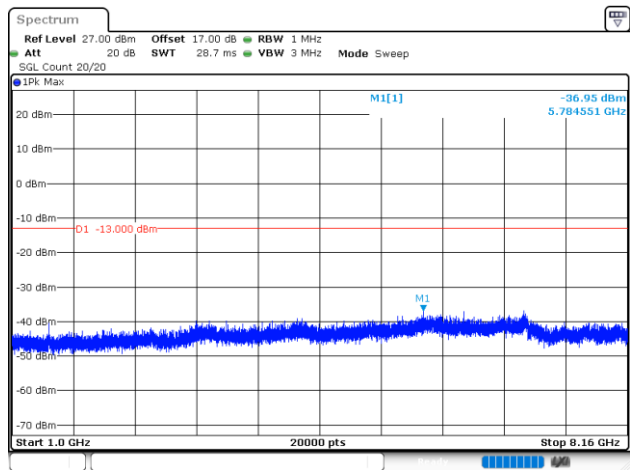


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:07:35

10MHz_Low_QPSK_1@0(30MHz~1GHz)

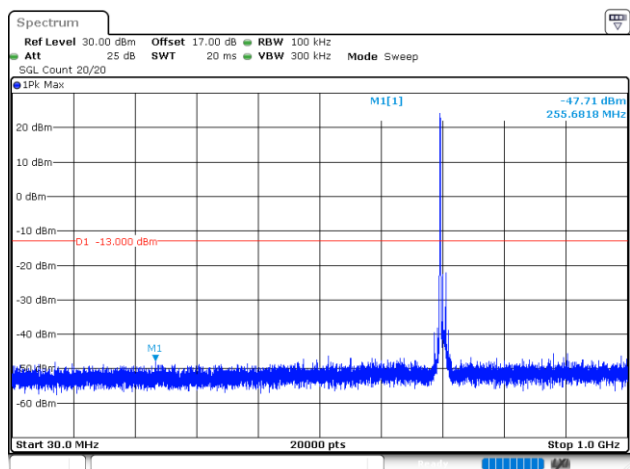


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 15:00:43

10MHz_Low_QPSK_1@0(1GHz~8.16GHz)

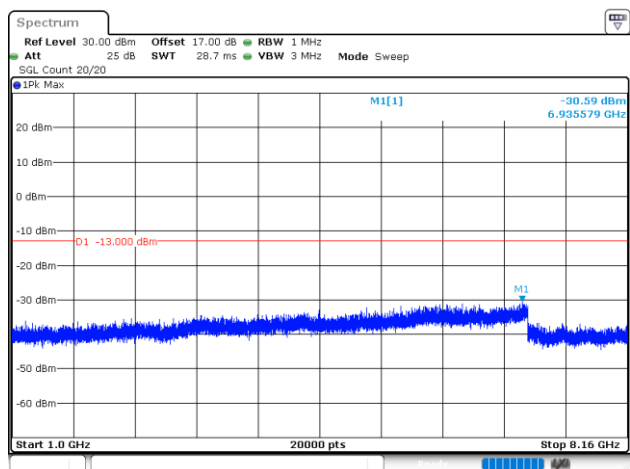


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 15:00:50

10MHz_Low_QPSK_50@0(30MHz~1GHz)

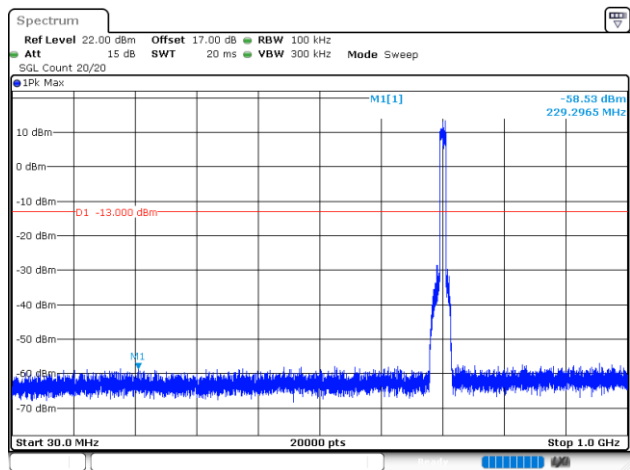


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:09:23

10MHz_Low_QPSK_50@0(1GHz~8.16GHz)

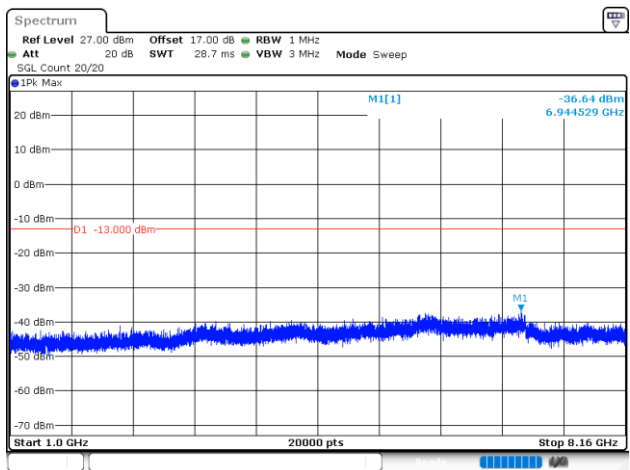


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:09:31

10MHz_Middle_QPSK_1@0(30MHz~1GHz)

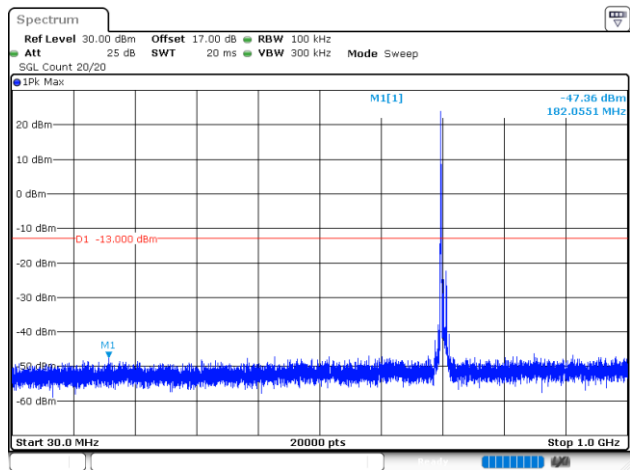


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 15:00:58

10MHz_Middle_QPSK_1@0(1GHz~8.16GHz)

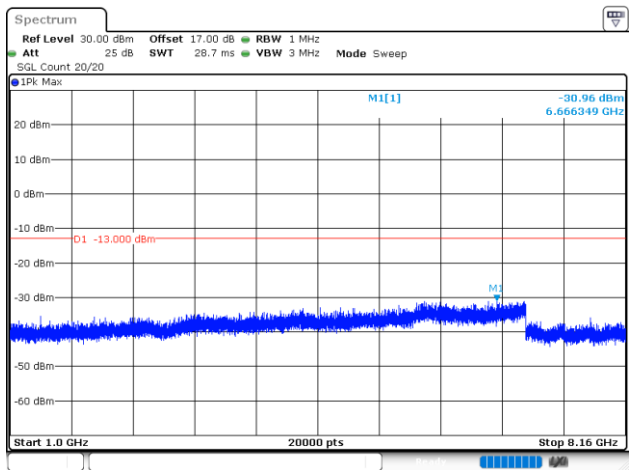


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 21.AUG.2025 15:01:06

10MHz_Middle_QPSK_50@0(30MHz~1GHz)

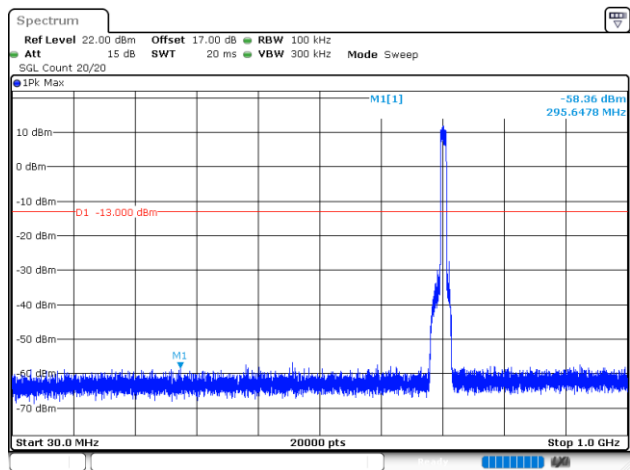


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:10:26

10MHz_Middle_QPSK_50@0(1GHz~8.16GHz)

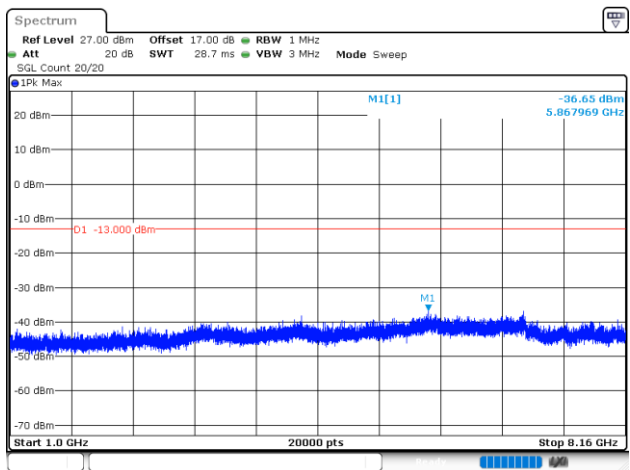


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 26.MAY.2025 18:10:34


10MHz_High_QPSK_1@0(30MHz~1GHz)

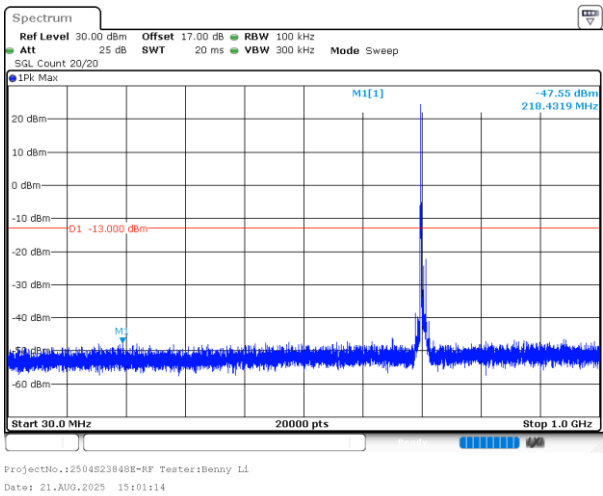


10MHz_High_QPSK_1@0(1GHz~8.16GHz)

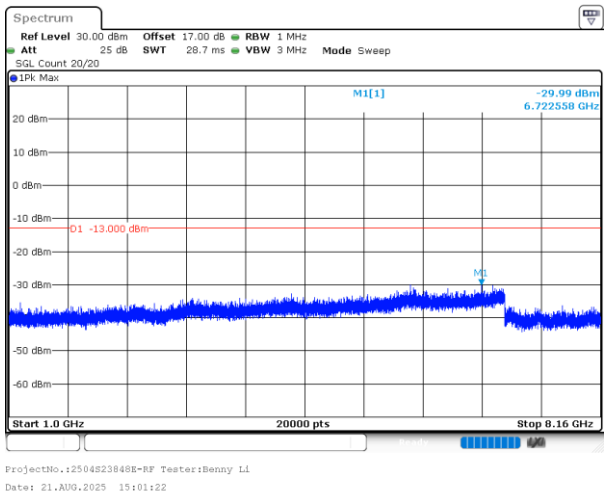

10MHz_High_QPSK_50@0(30MHz~1GHz)

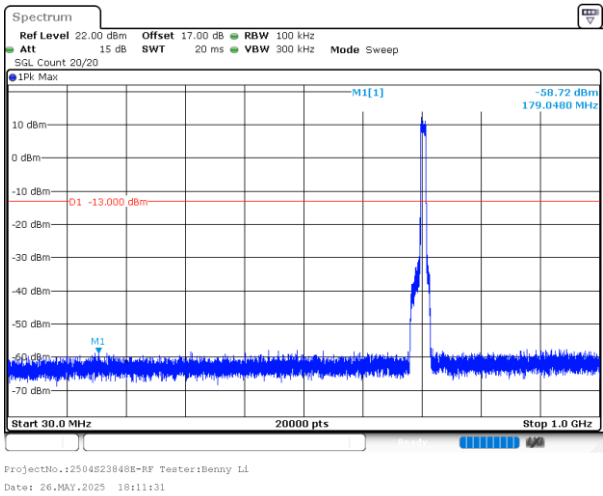


10MHz_High_QPSK_50@0(1GHz~8.16GHz)

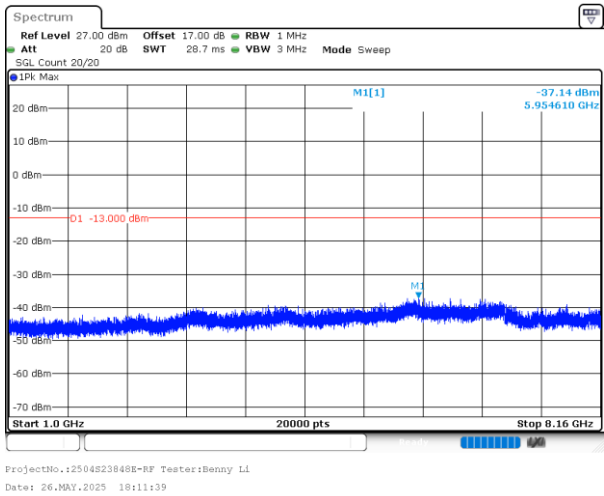


LTE Band 38, Normal
1RB was the worst case


5MHz_Low_QPSK_1@0(30MHz~1GHz)

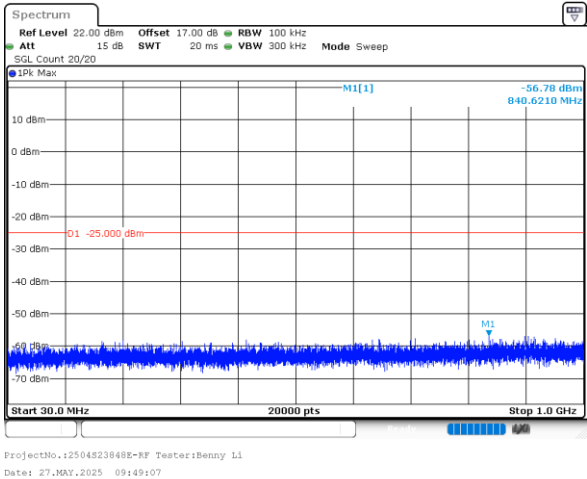

5MHz_Low_QPSK_1@0(1GHz~27.2GHz)

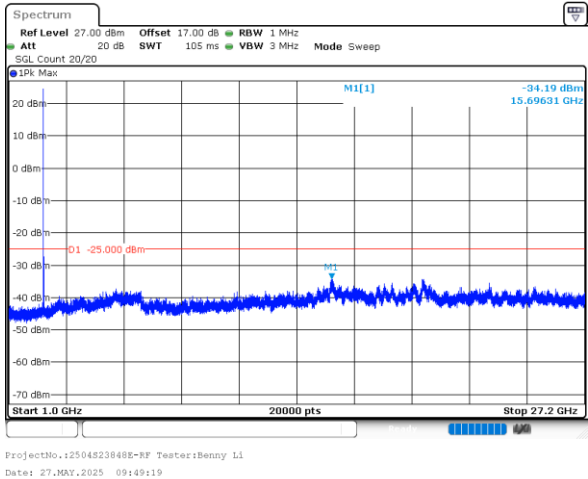


5MHz_Low_QPSK_25@0(30MHz~1GHz)

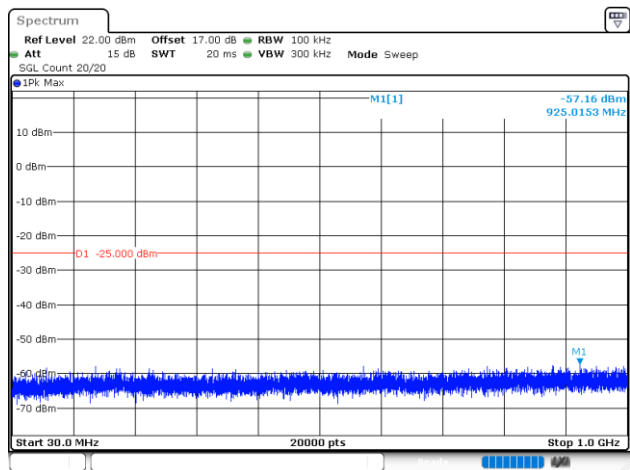


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:49:37

5MHz_Low_QPSK_25@0(1GHz~27.2GHz)

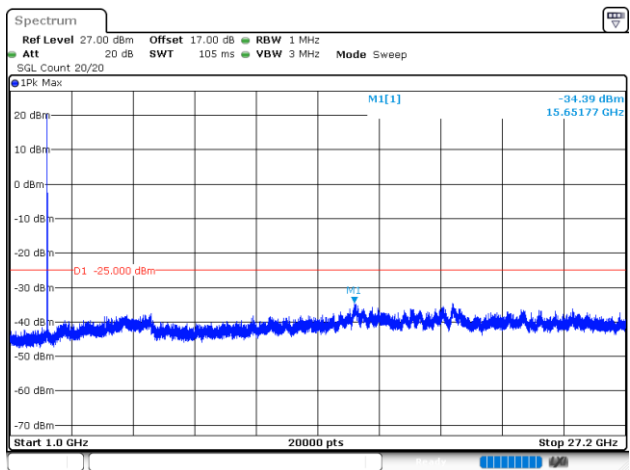


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:49:49

5MHz_Middle_QPSK_1@0(30MHz~1GHz)

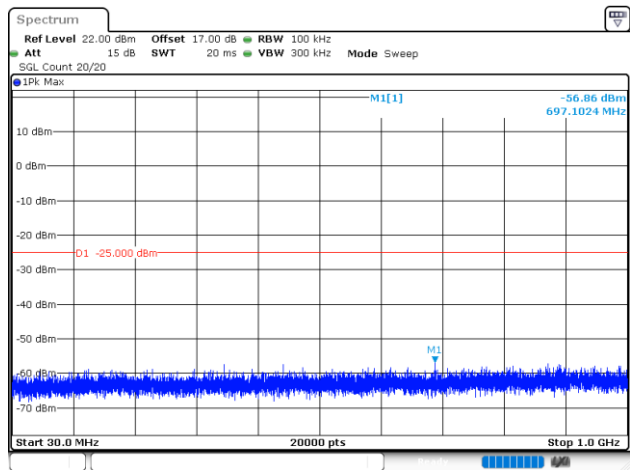


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:50:06

5MHz_Middle_QPSK_1@0(1GHz~27.2GHz)

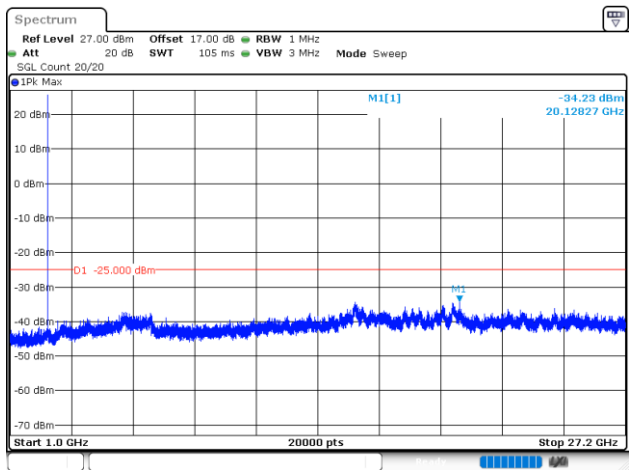


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:50:18

5MHz_Middle_QPSK_25@0(30MHz~1GHz)

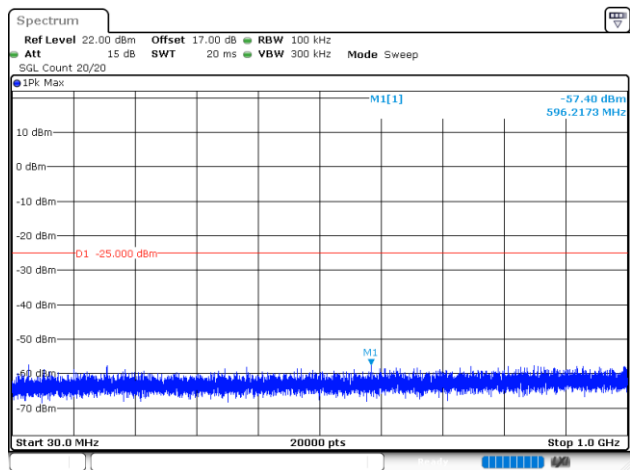


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:50:36

5MHz_Middle_QPSK_25@0(1GHz~27.2GHz)

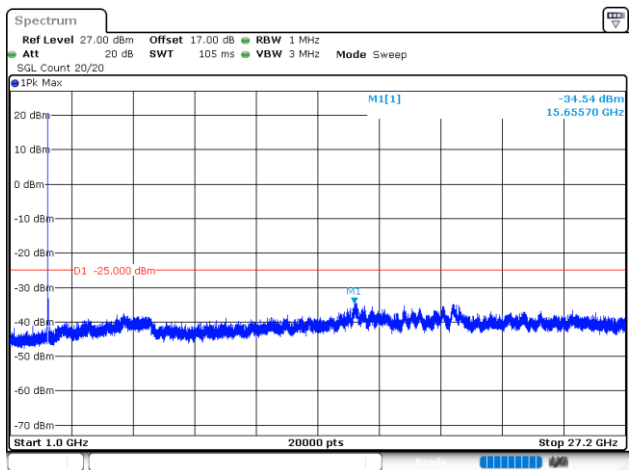


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:50:49

5MHz_High_QPSK_1@0(30MHz~1GHz)

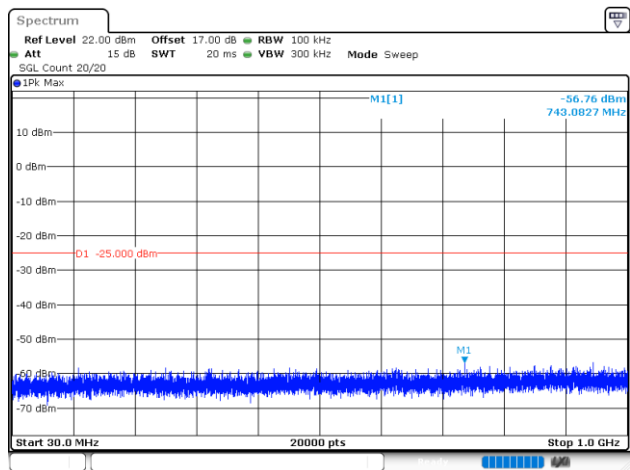


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:51:07

5MHz_High_QPSK_1@0(1GHz~27.2GHz)

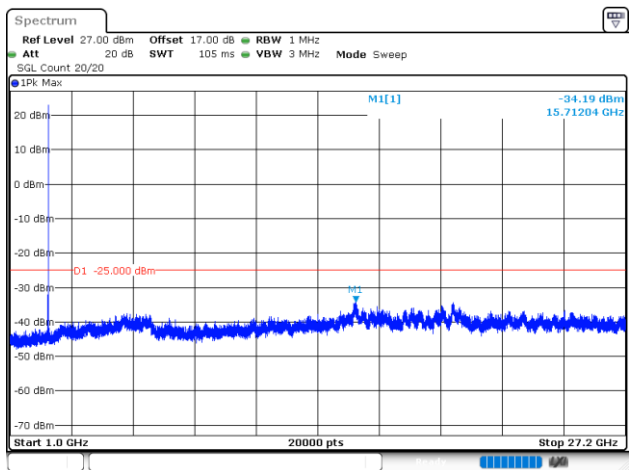


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:51:19

5MHz_High_QPSK_25@0(30MHz~1GHz)

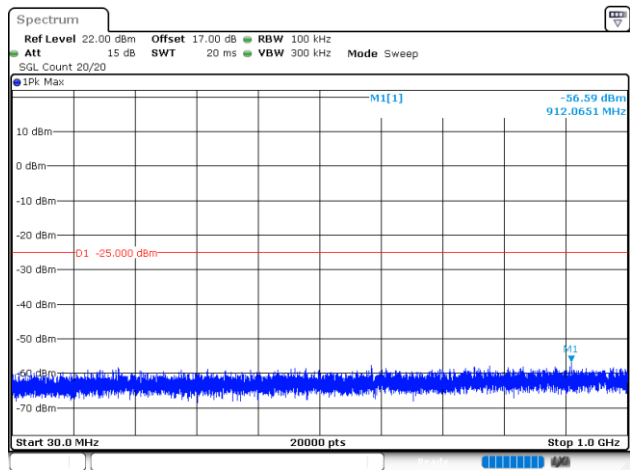


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:51:37

5MHz_High_QPSK_25@0(1GHz~27.2GHz)

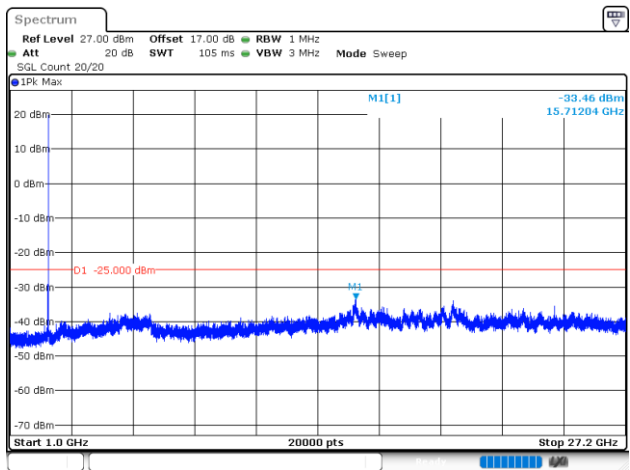


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:51:50

10MHz_Low_QPSK_1@0(30MHz~1GHz)

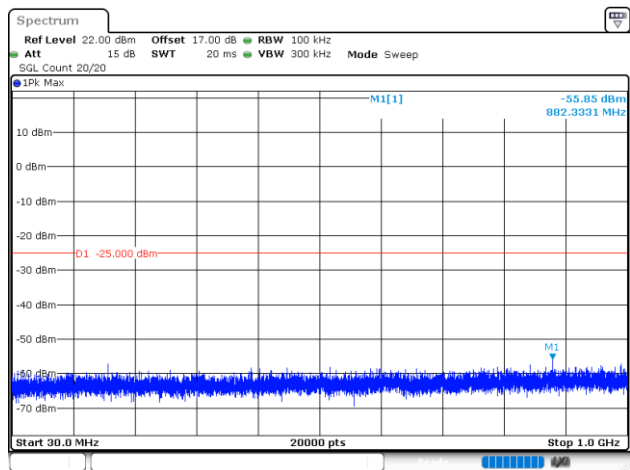


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:52:55

10MHz_Low_QPSK_1@0(1GHz~27.2GHz)

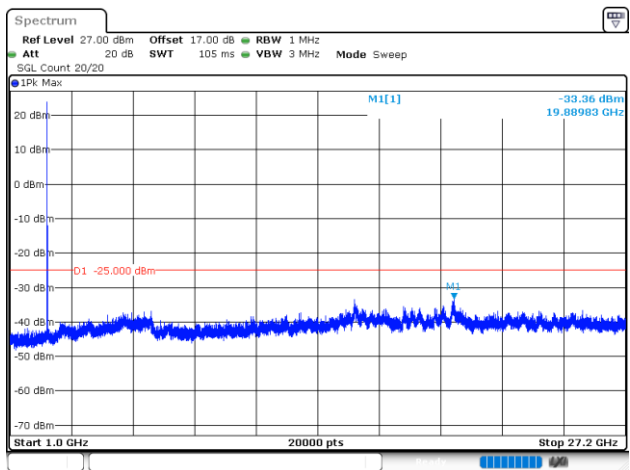


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:53:07

10MHz_Low_QPSK_50@0(30MHz~1GHz)

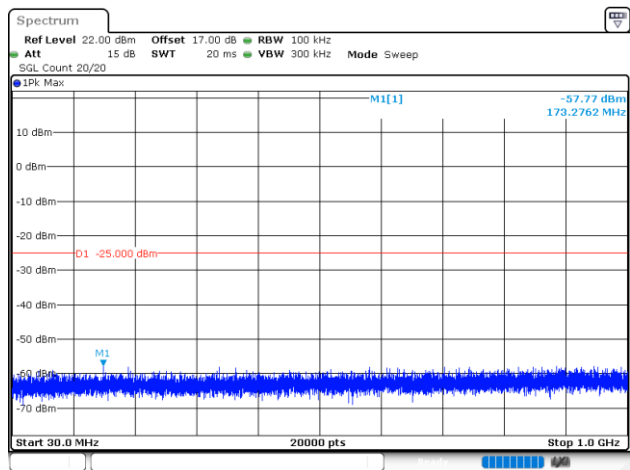


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:53:27

10MHz_Low_QPSK_50@0(1GHz~27.2GHz)

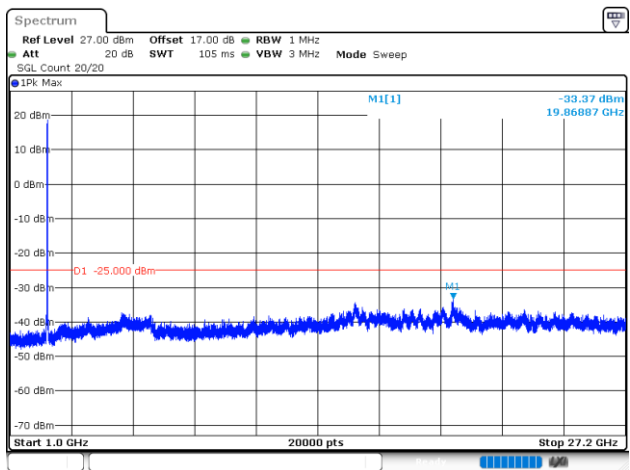


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:53:39

10MHz_Middle_QPSK_1@0(30MHz~1GHz)

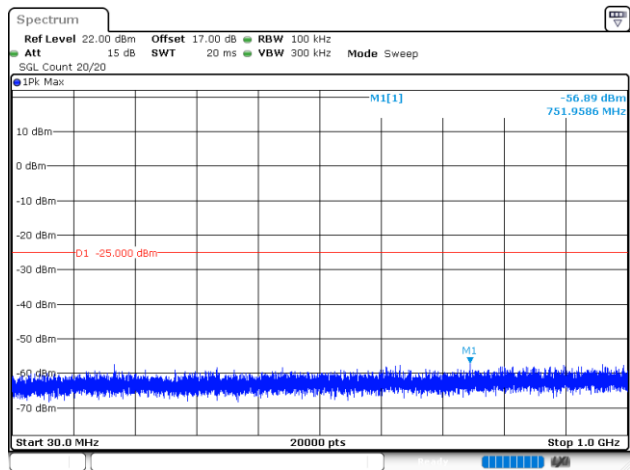


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:53:58

10MHz_Middle_QPSK_1@0(1GHz~27.2GHz)

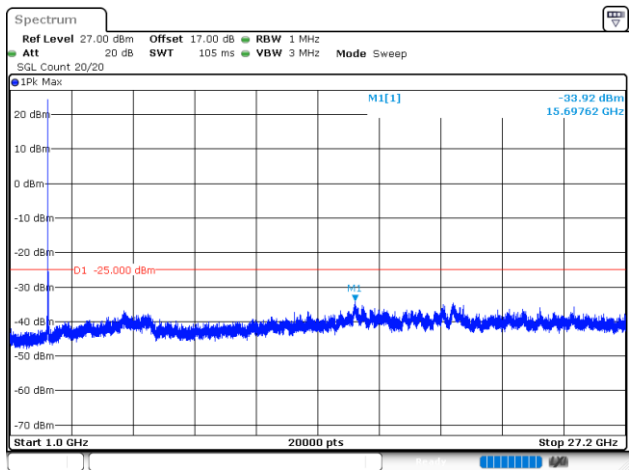


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:54:10

10MHz_Middle_QPSK_50@0(30MHz~1GHz)

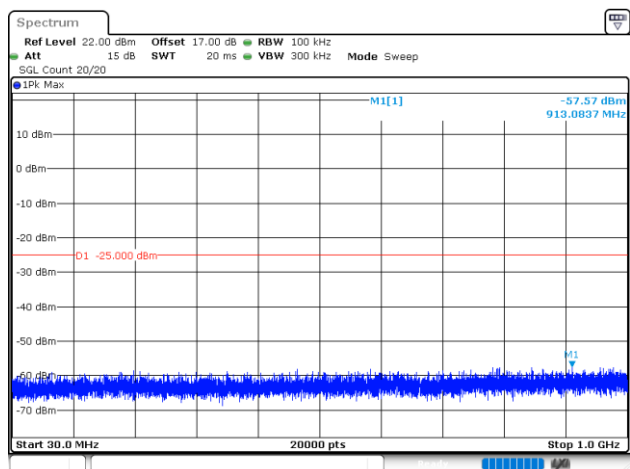


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:54:29

10MHz_Middle_QPSK_50@0(1GHz~27.2GHz)

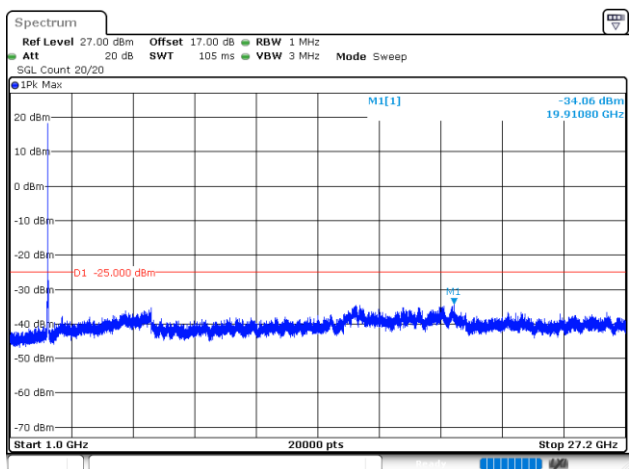


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 19.AUG.2025 18:49:08

10MHz_High_QPSK_1@0(30MHz~1GHz)

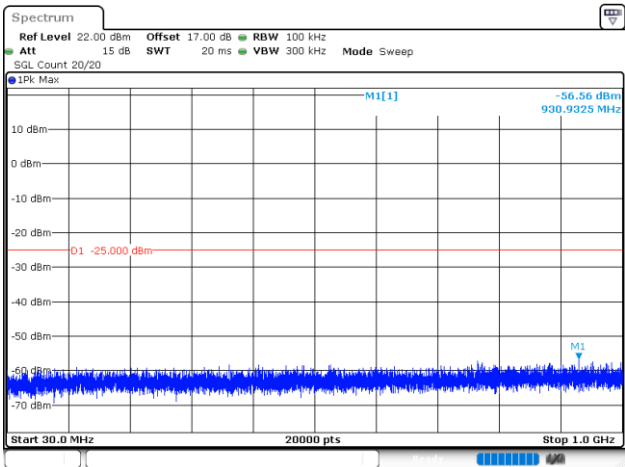


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:55:32

10MHz_High_QPSK_1@0(1GHz~27.2GHz)

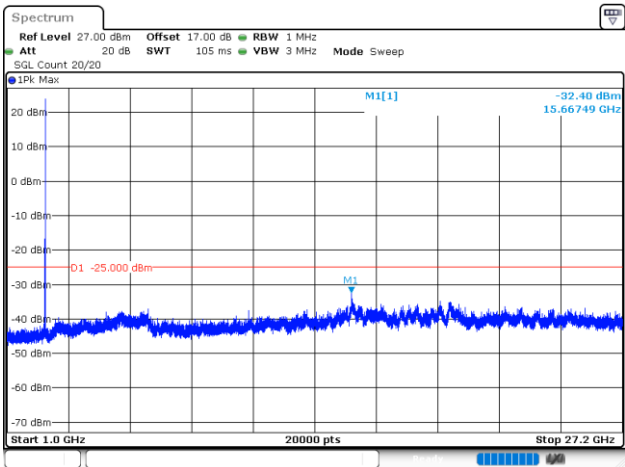


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:55:44

10MHz_High_QPSK_50@0(30MHz~1GHz)

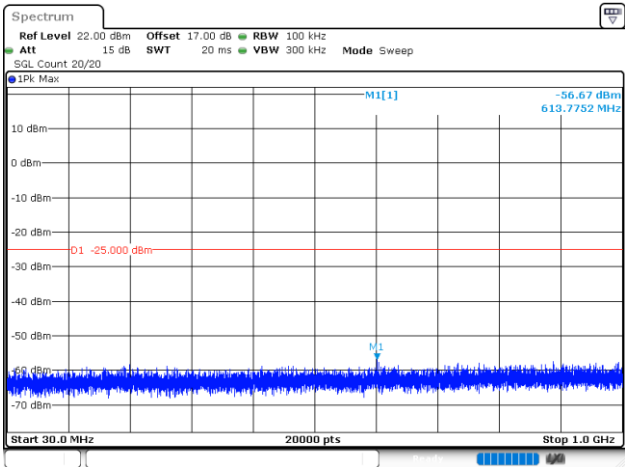


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:56:04

10MHz_High_QPSK_50@0(1GHz~27.2GHz)

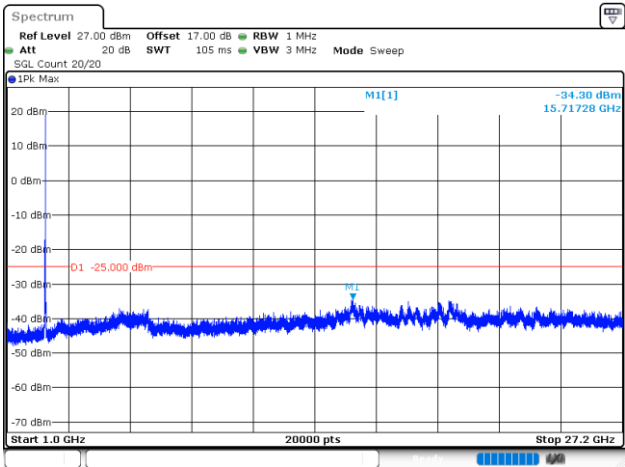


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 09:56:17

15MHz_Low_QPSK_1@0(30MHz~1GHz)

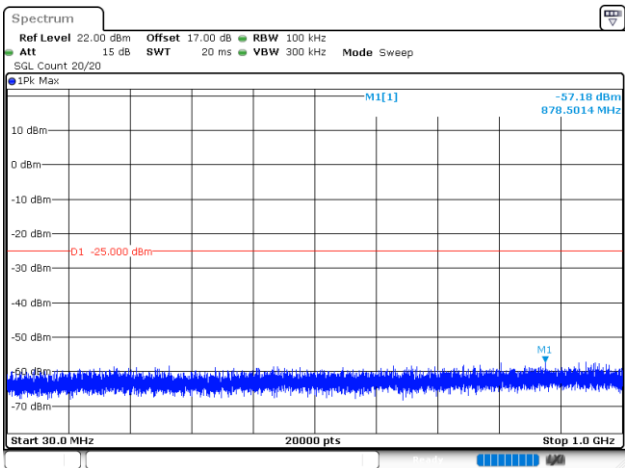


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:01:52

15MHz_Low_QPSK_1@0(1GHz~27.2GHz)

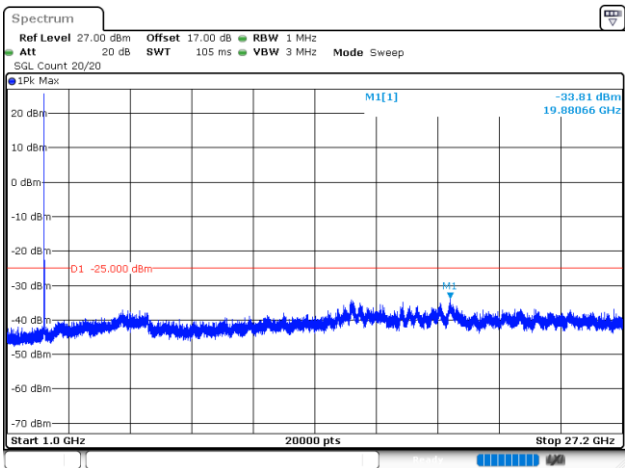


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:02:04

15MHz_Low_QPSK_75@0(30MHz~1GHz)

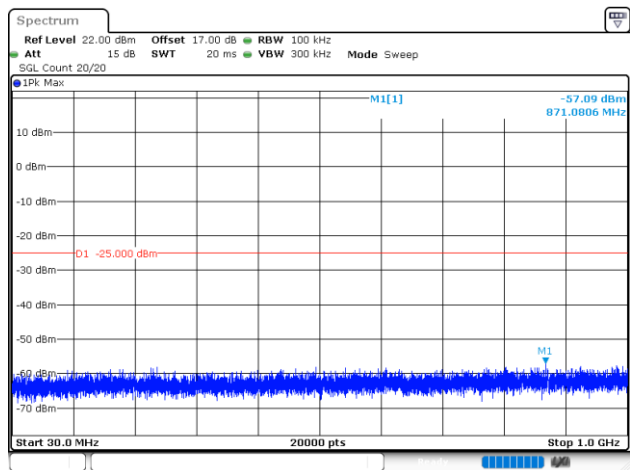


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:02:38

15MHz_Low_QPSK_75@0(1GHz~27.2GHz)

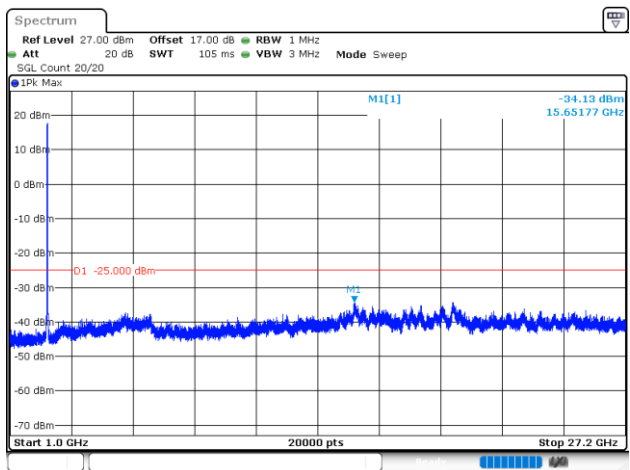


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:02:51

15MHz_Middle_QPSK_1@0(30MHz~1GHz)

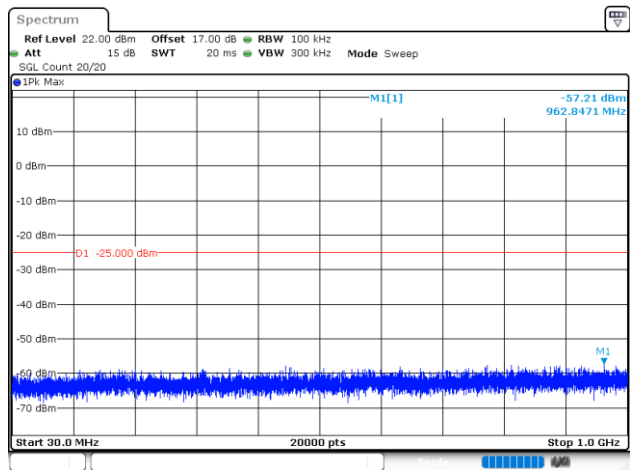


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:03:26

15MHz_Middle_QPSK_1@0(1GHz~27.2GHz)

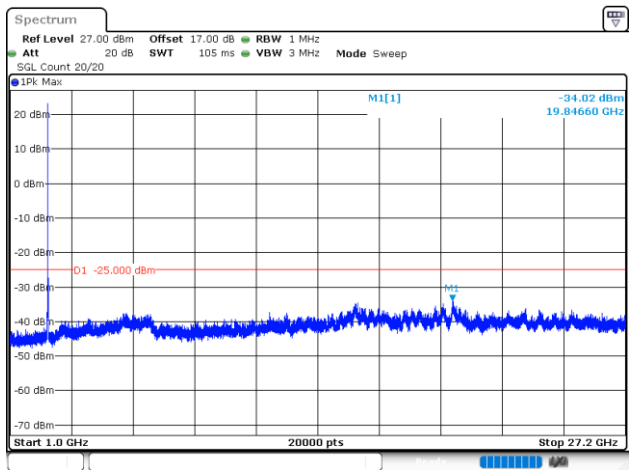


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:03:39

15MHz_Middle_QPSK_75@0(30MHz~1GHz)

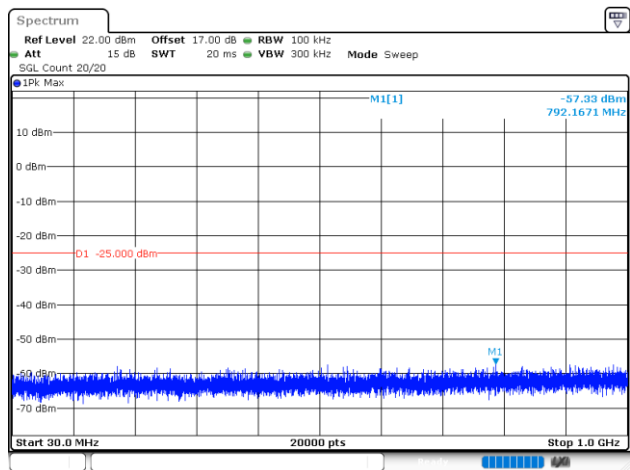


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:04:01

15MHz_Middle_QPSK_75@0(1GHz~27.2GHz)

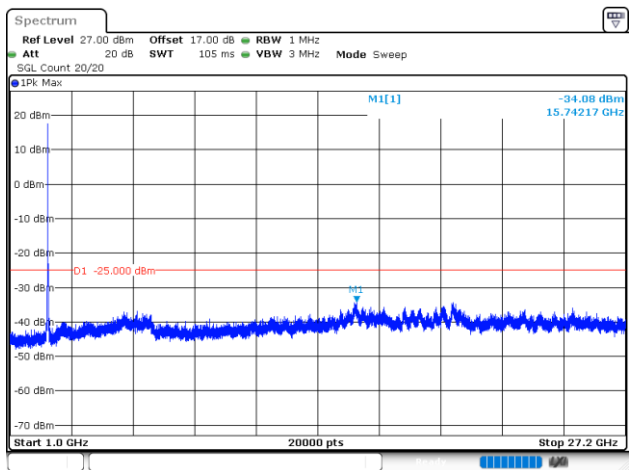


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:04:14

15MHz_High_QPSK_1@0(30MHz~1GHz)

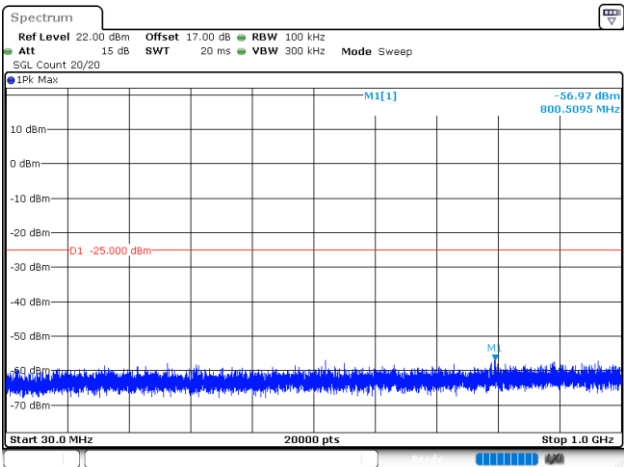


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:04:35

15MHz_High_QPSK_1@0(1GHz~27.2GHz)

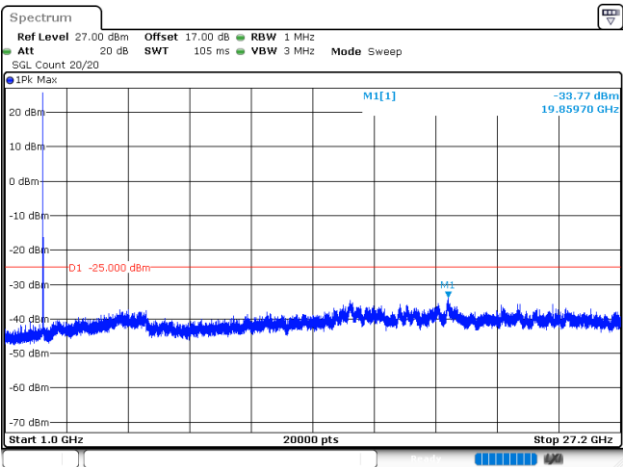


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:04:48

15MHz_High_QPSK_75@0(30MHz~1GHz)

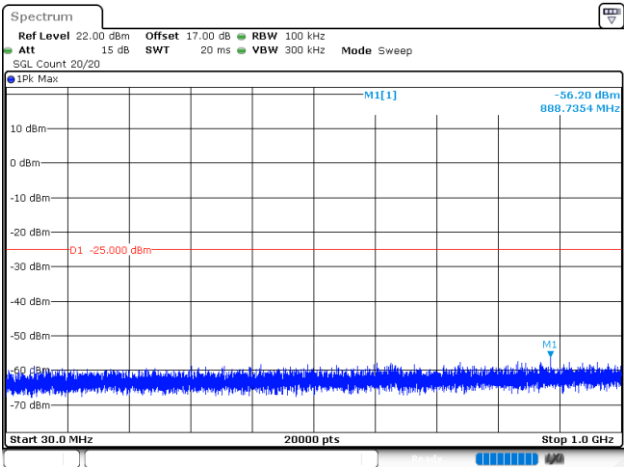


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:05:11

15MHz_High_QPSK_75@0(1GHz~27.2GHz)

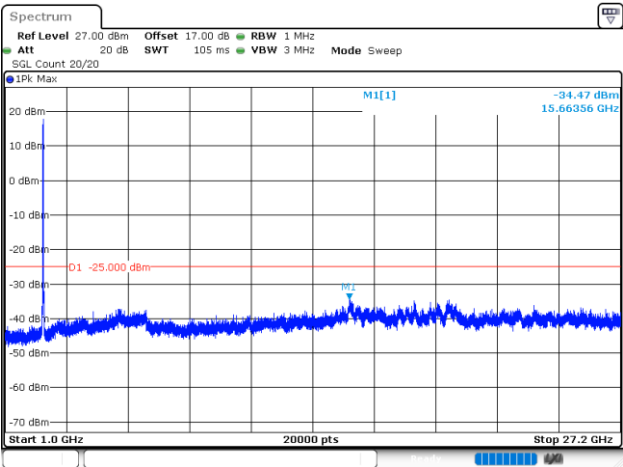


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:05:24

20MHz_Low_QPSK_1@0(30MHz~1GHz)

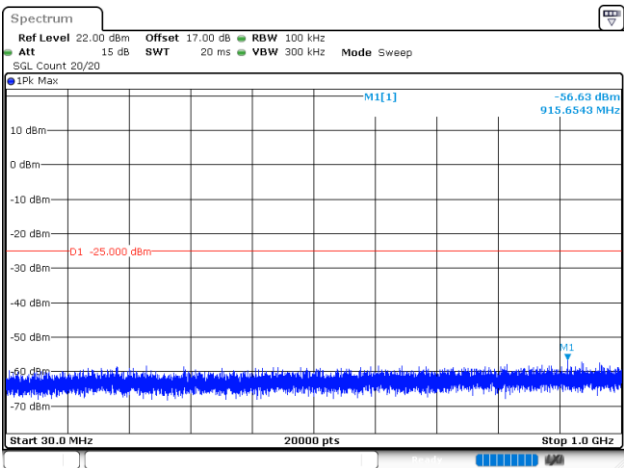


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:07:53

20MHz_Low_QPSK_1@0(1GHz~27.2GHz)

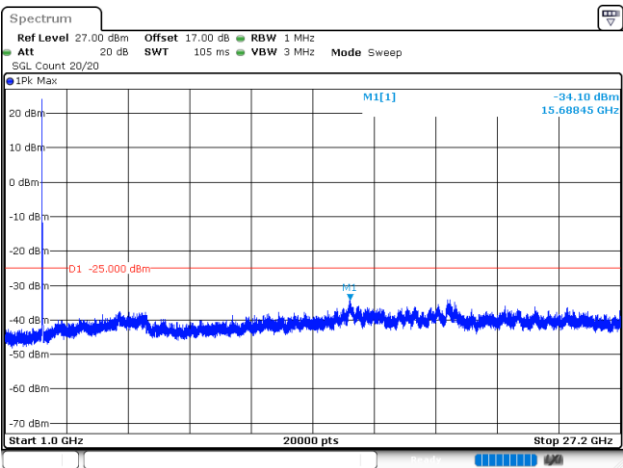


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:08:07

20MHz_Low_QPSK_100@0(30MHz~1GHz)

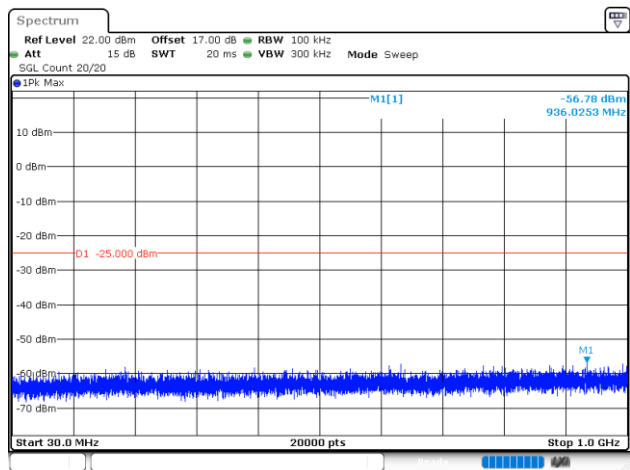


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:08:30

20MHz_Low_QPSK_100@0(1GHz~27.2GHz)

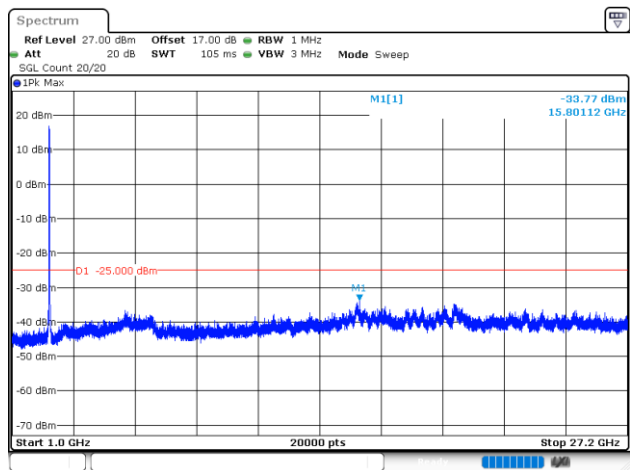


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:08:43

20MHz_Middle_QPSK_1@0(30MHz~1GHz)

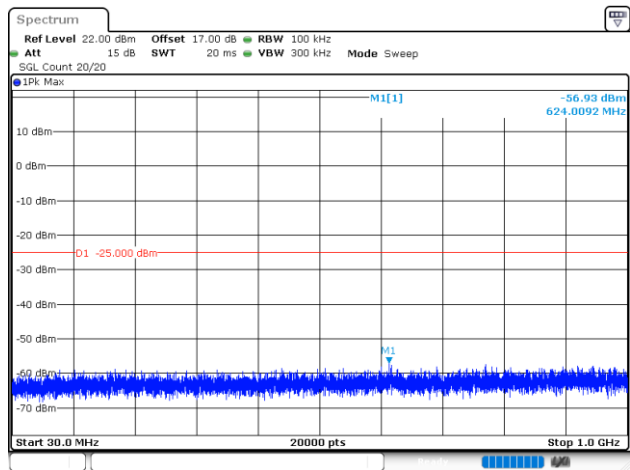


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:09:19

20MHz_Middle_QPSK_1@0(1GHz~27.2GHz)

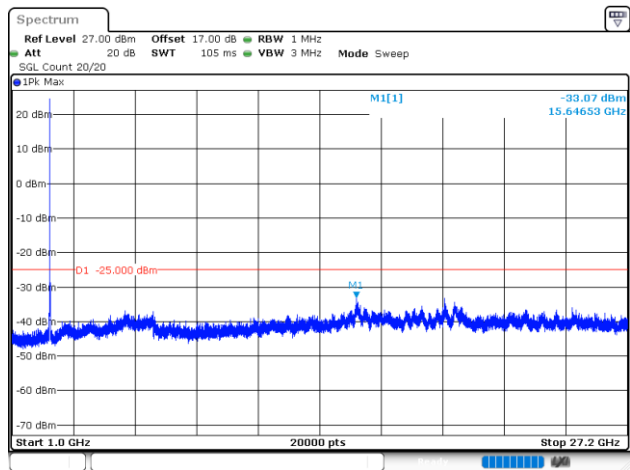


ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:09:33

20MHz_Middle_QPSK_100@0(30MHz~1GHz)

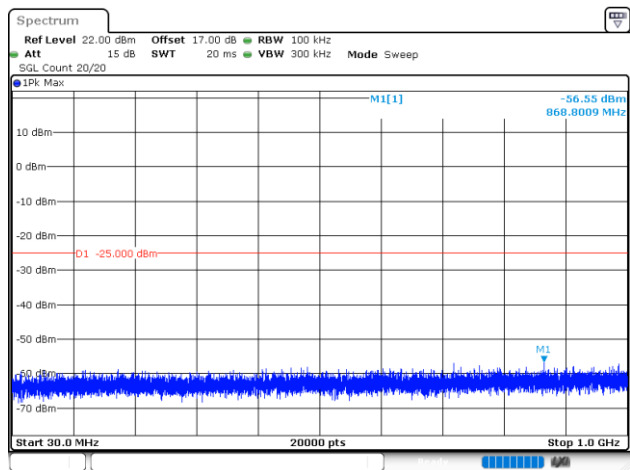

ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 27.MAY.2025 10:09:56

20MHz_Middle_QPSK_100@0(1GHz~27.2GHz)

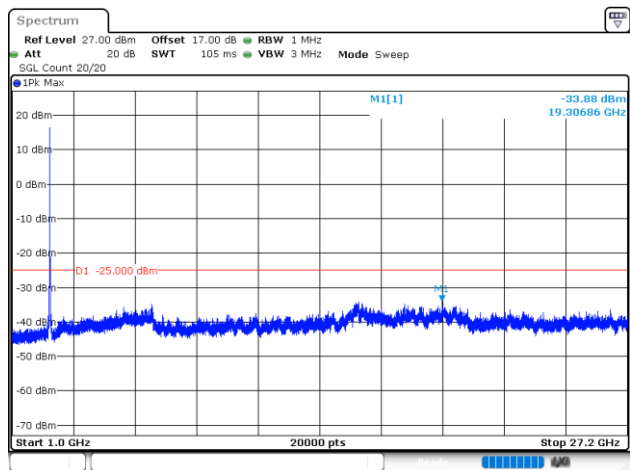

ProjectNo.:2504S23848E-RF Tester:Benny Li
Date: 19.AUG.2025 18:49:32