






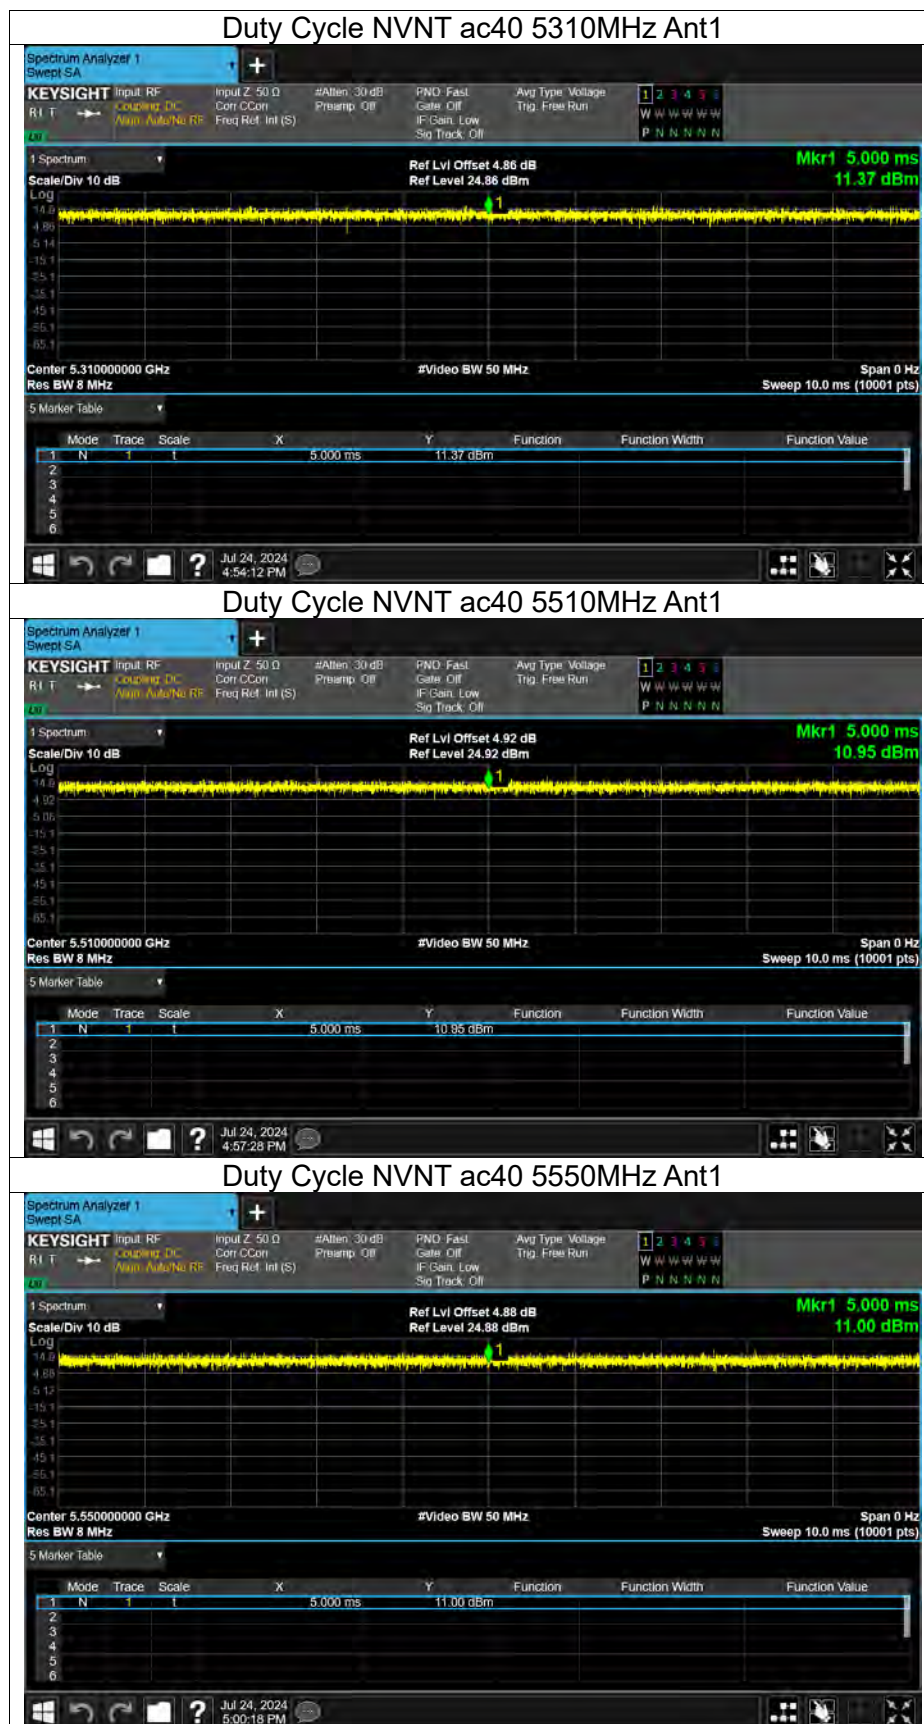


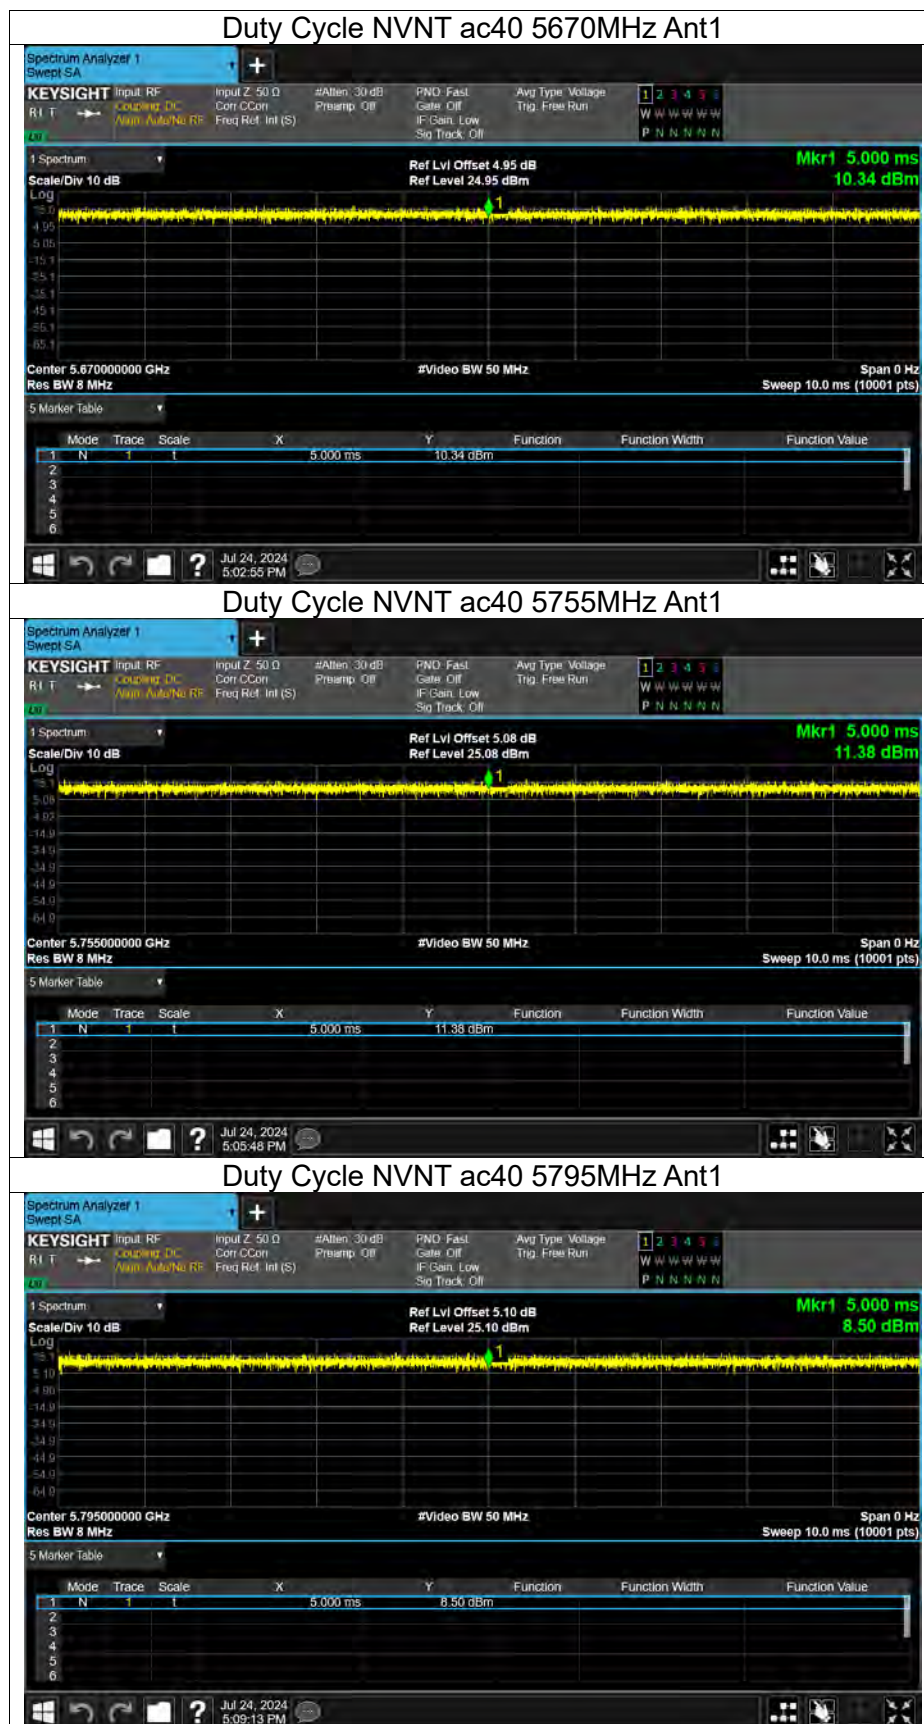


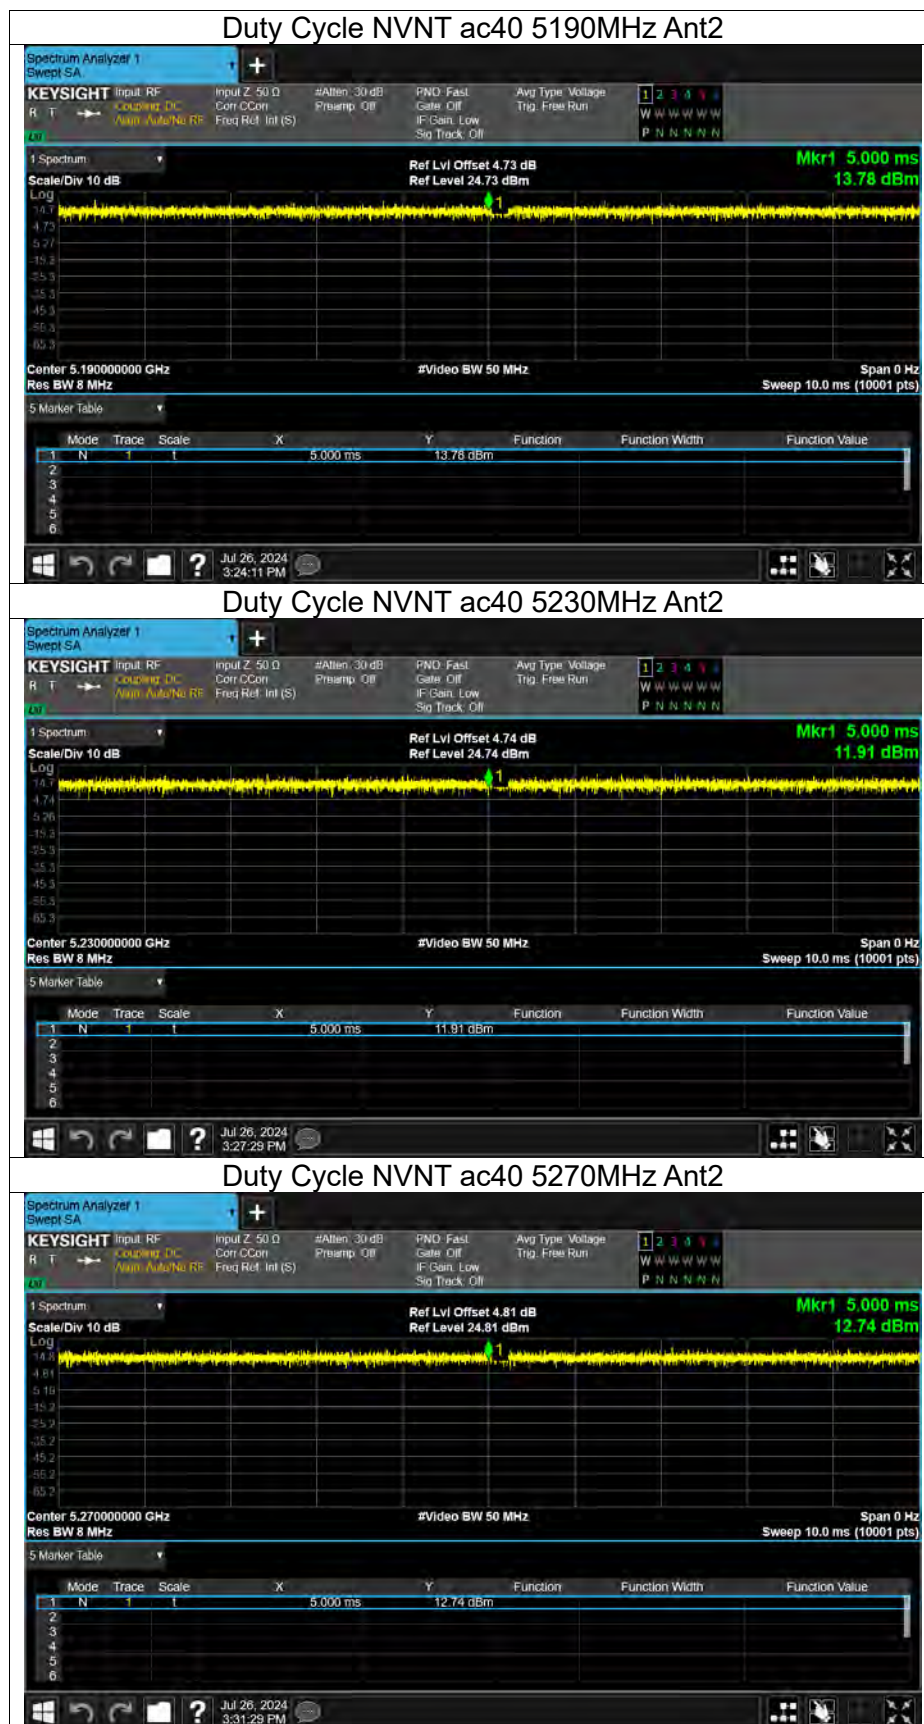


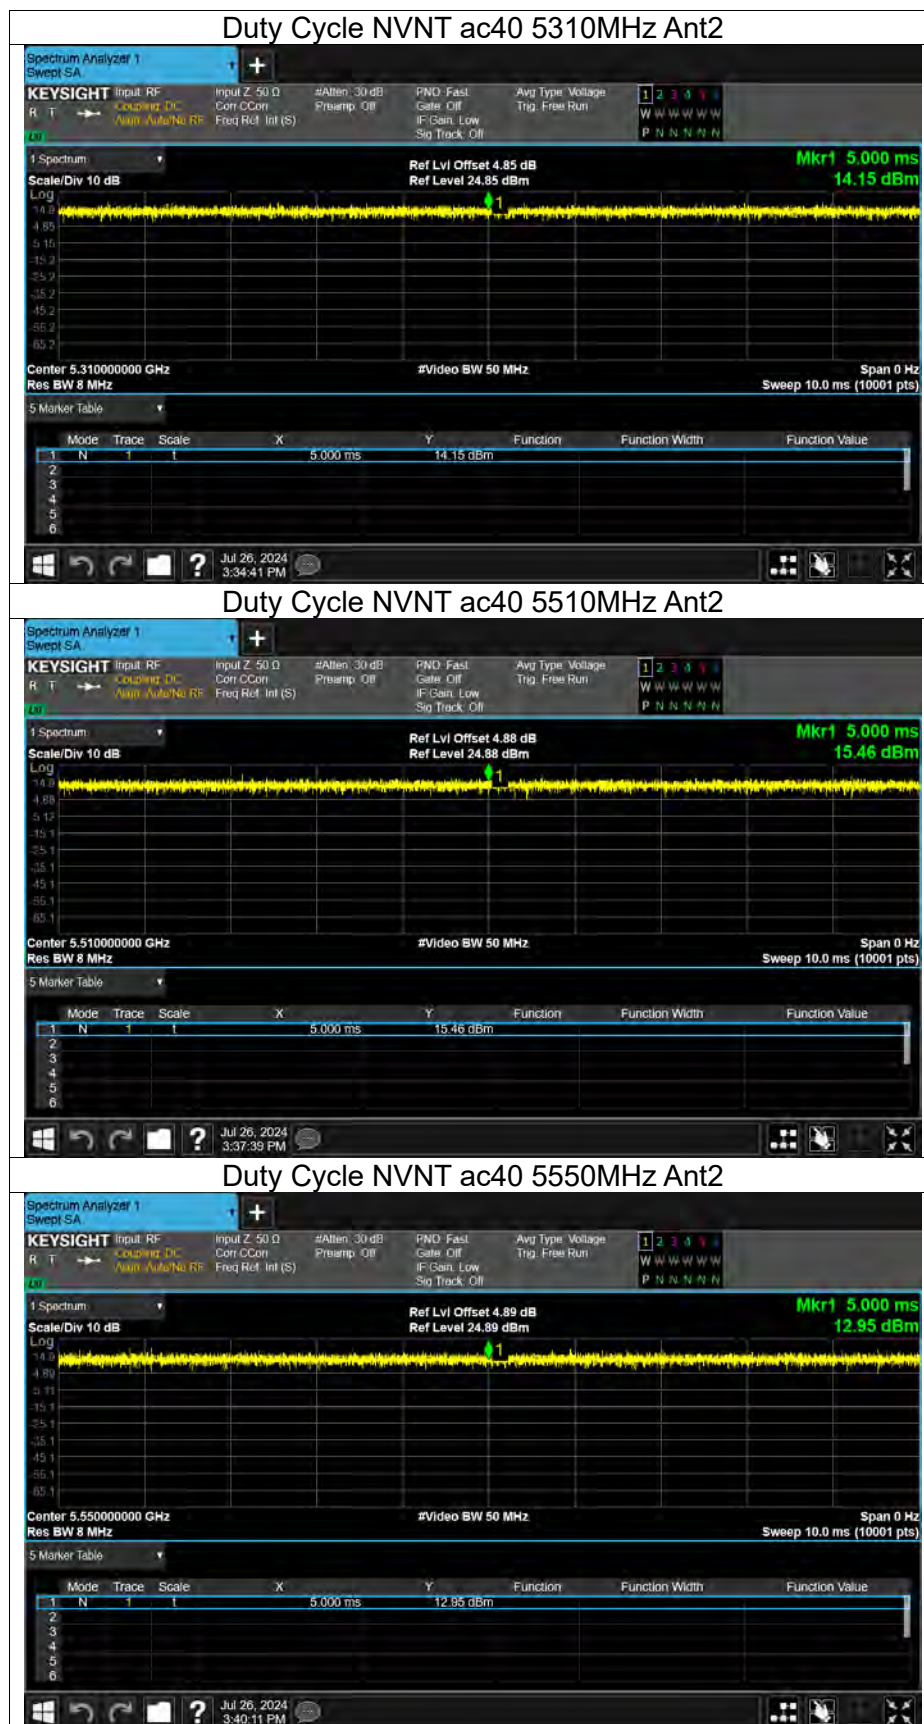


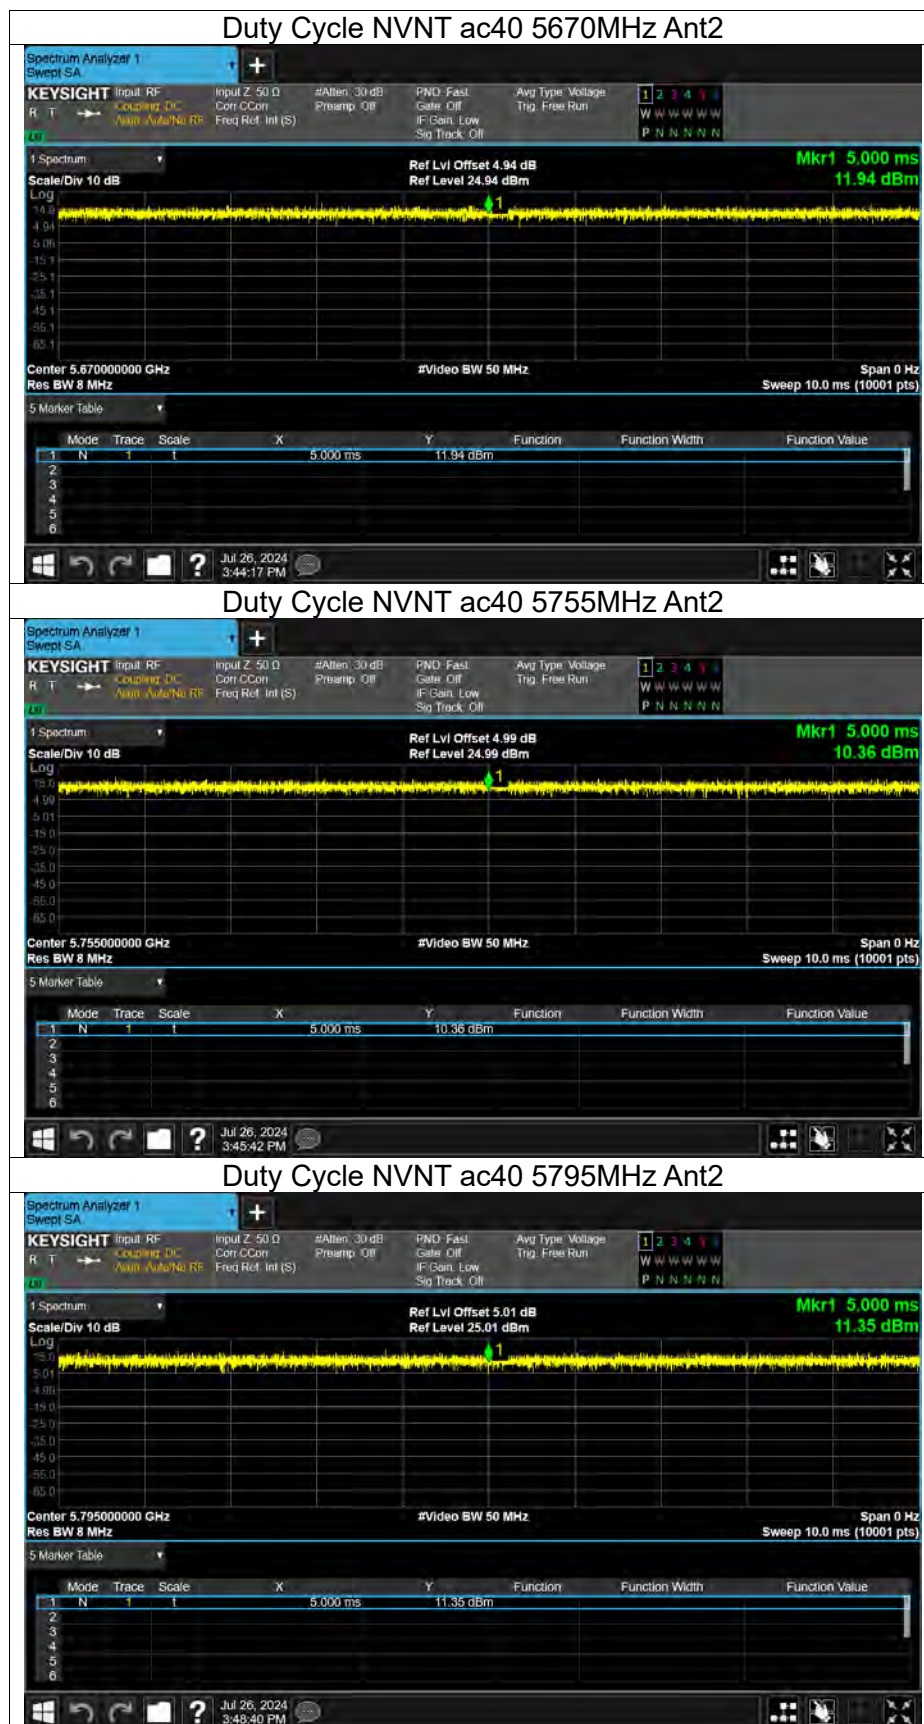


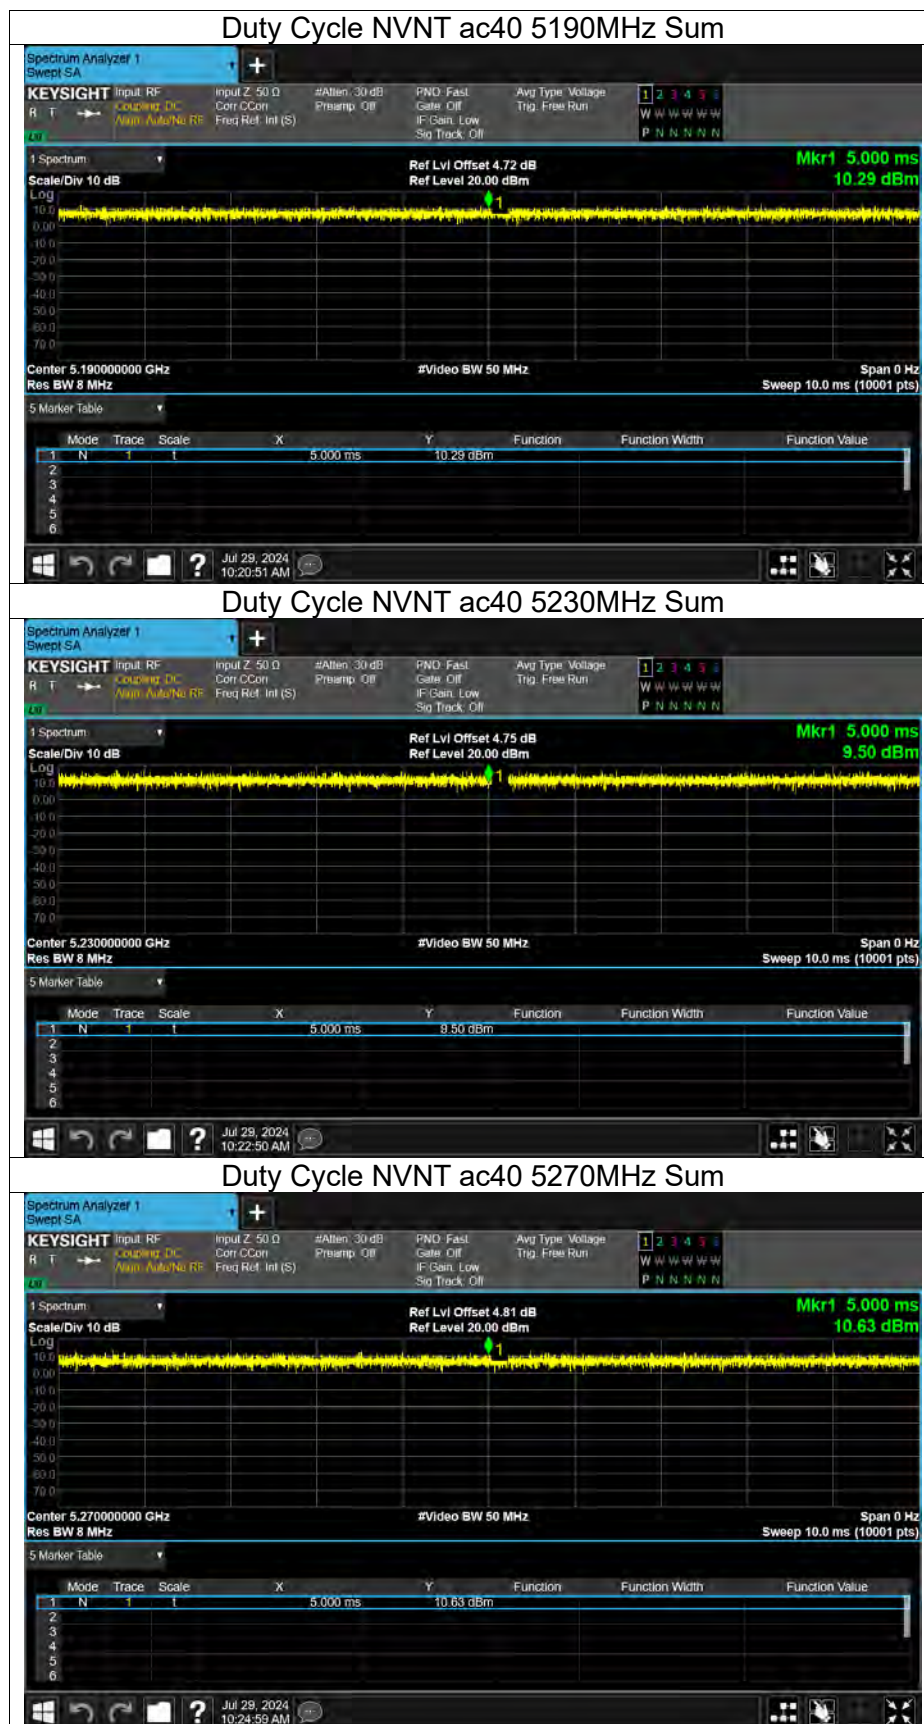


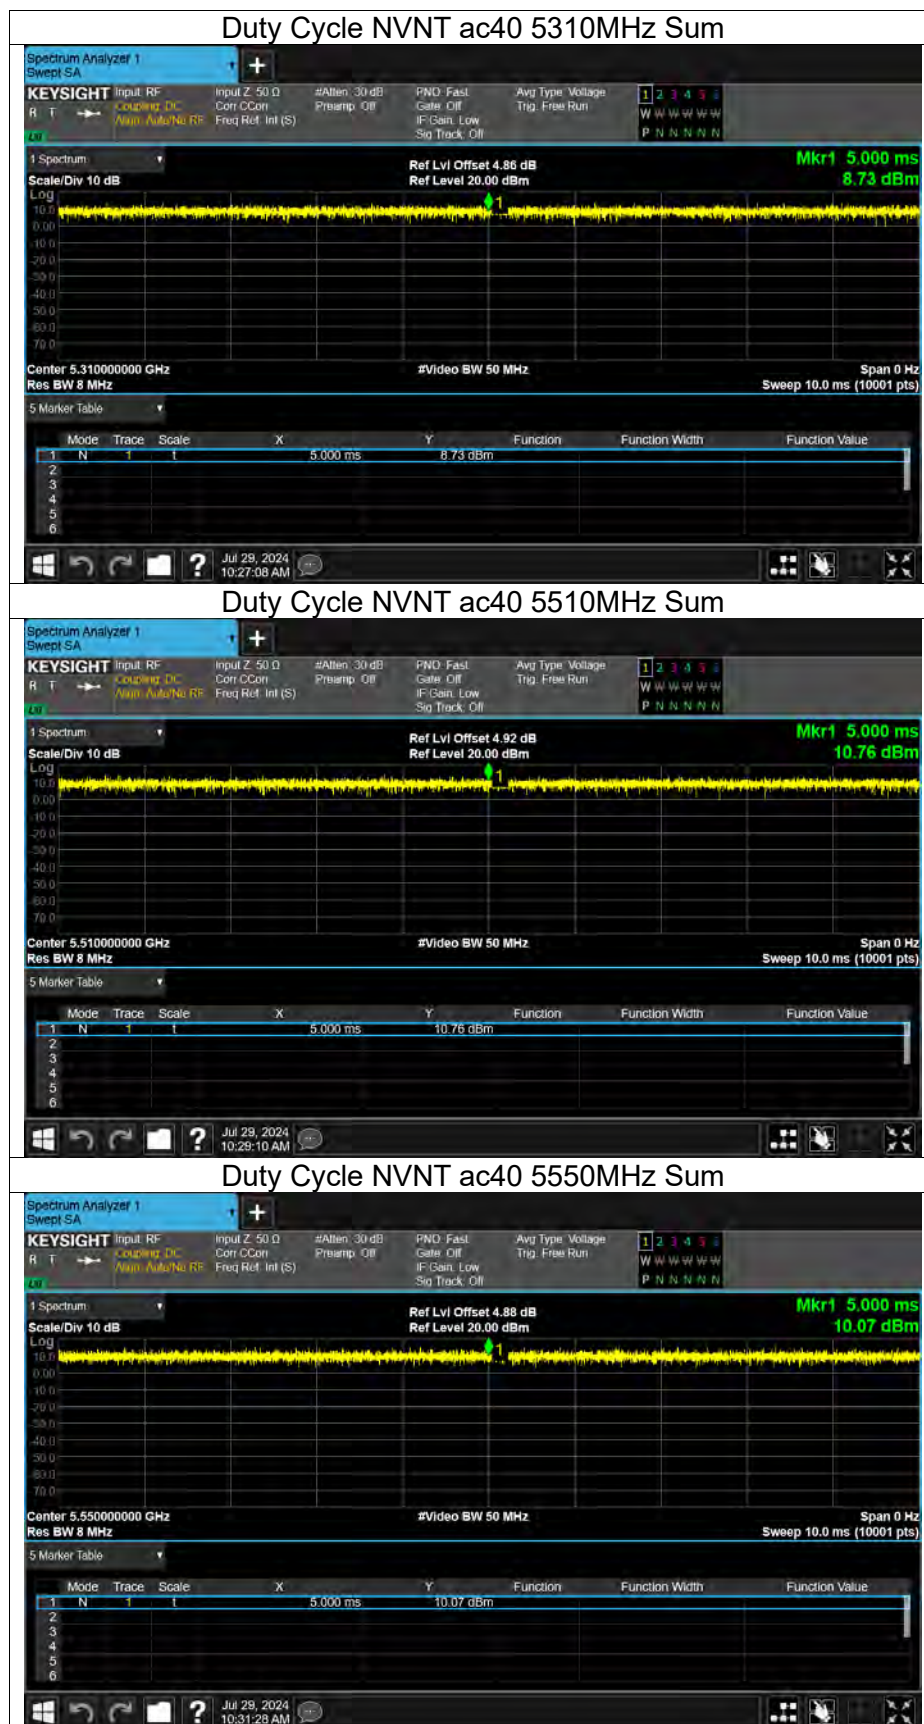


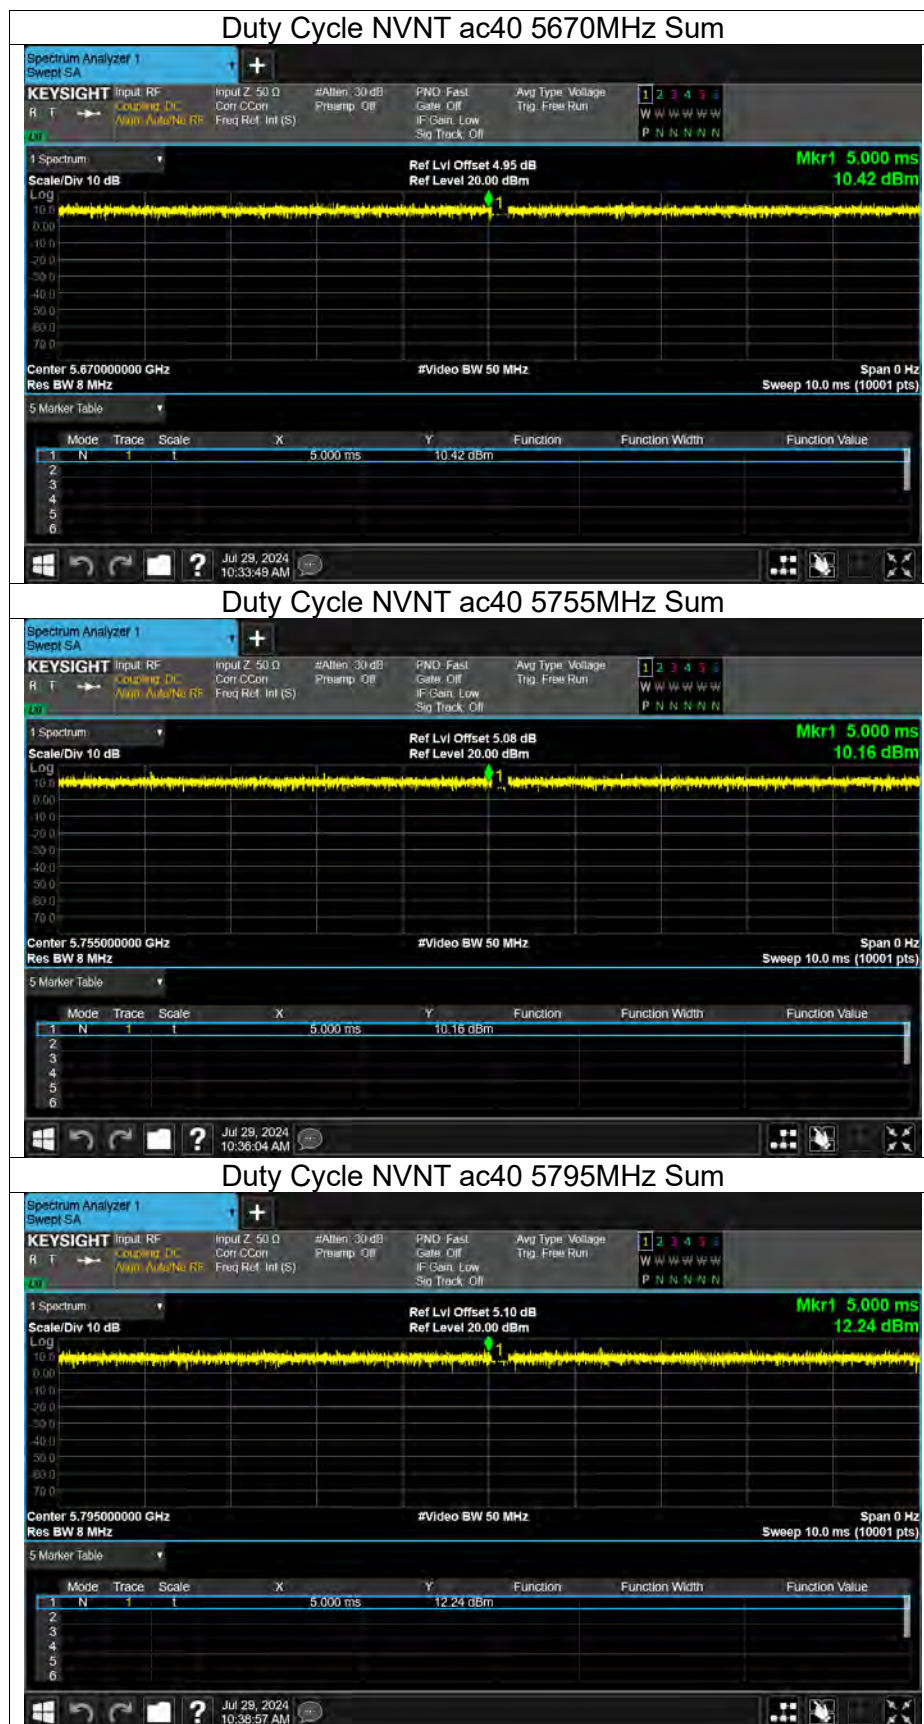


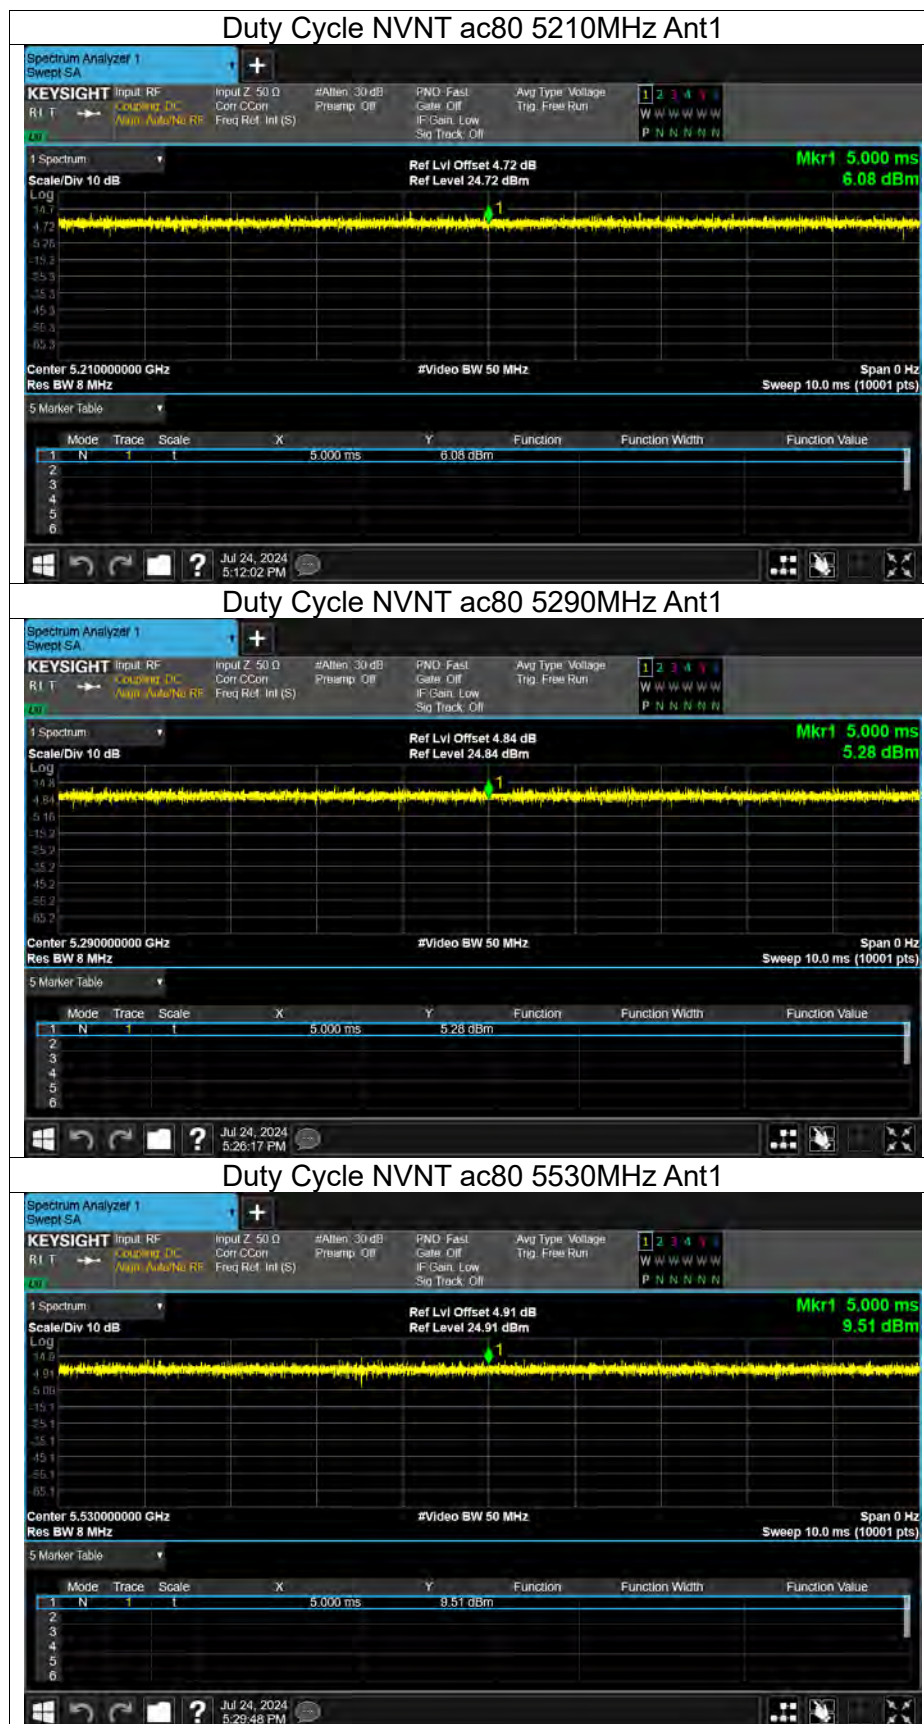


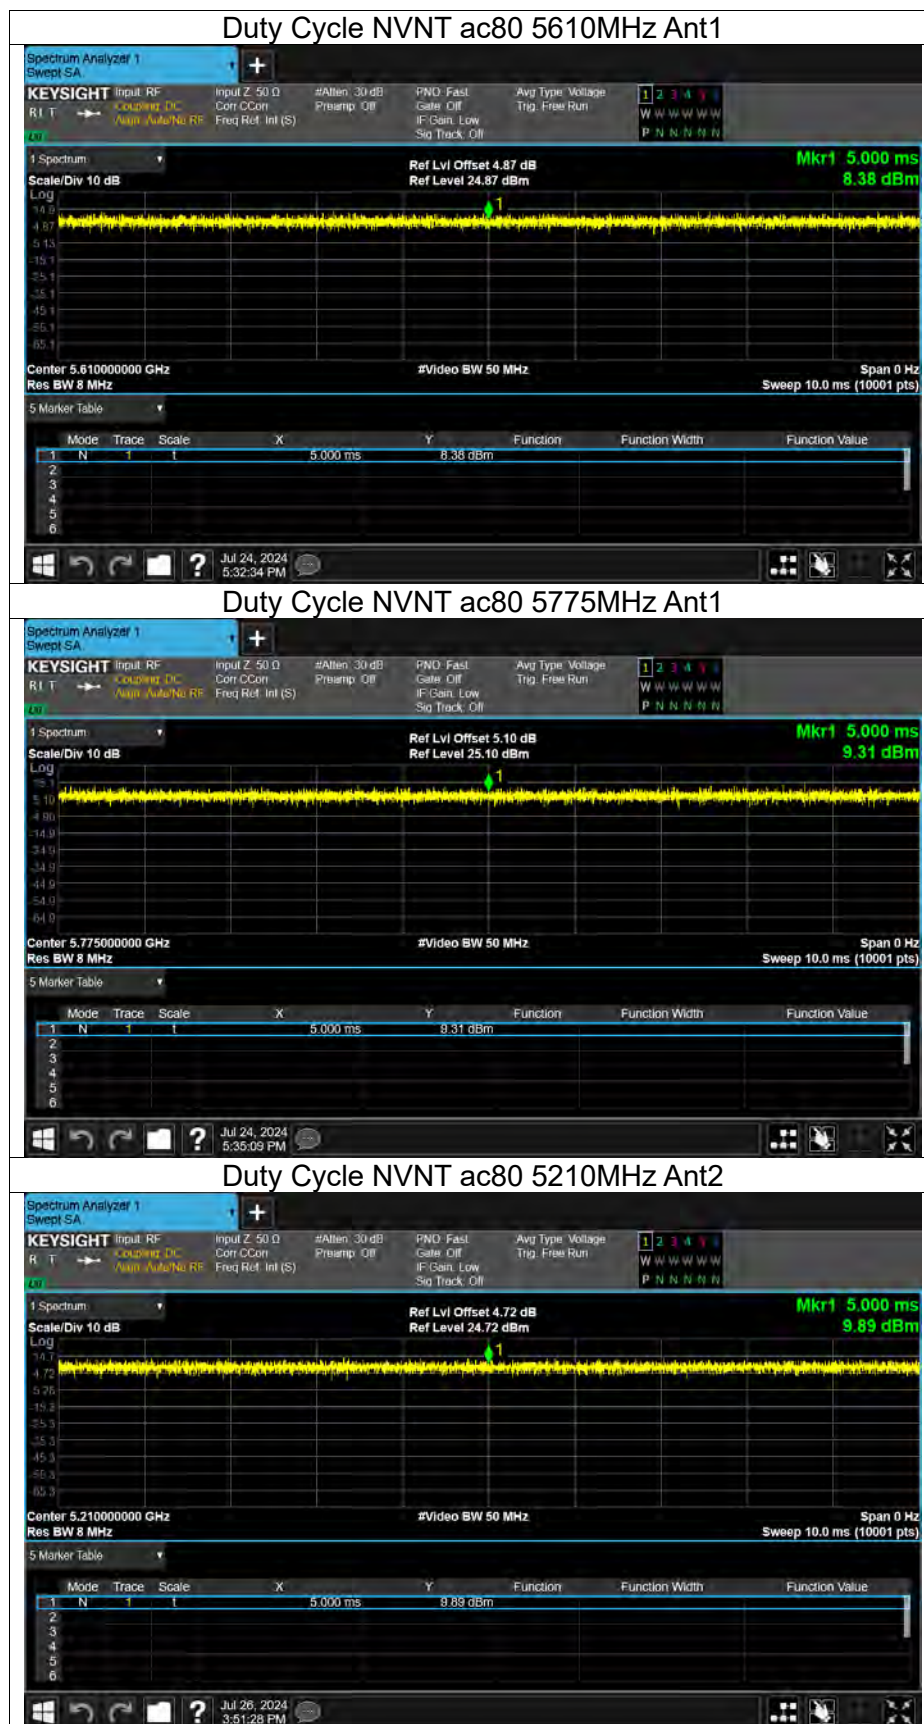


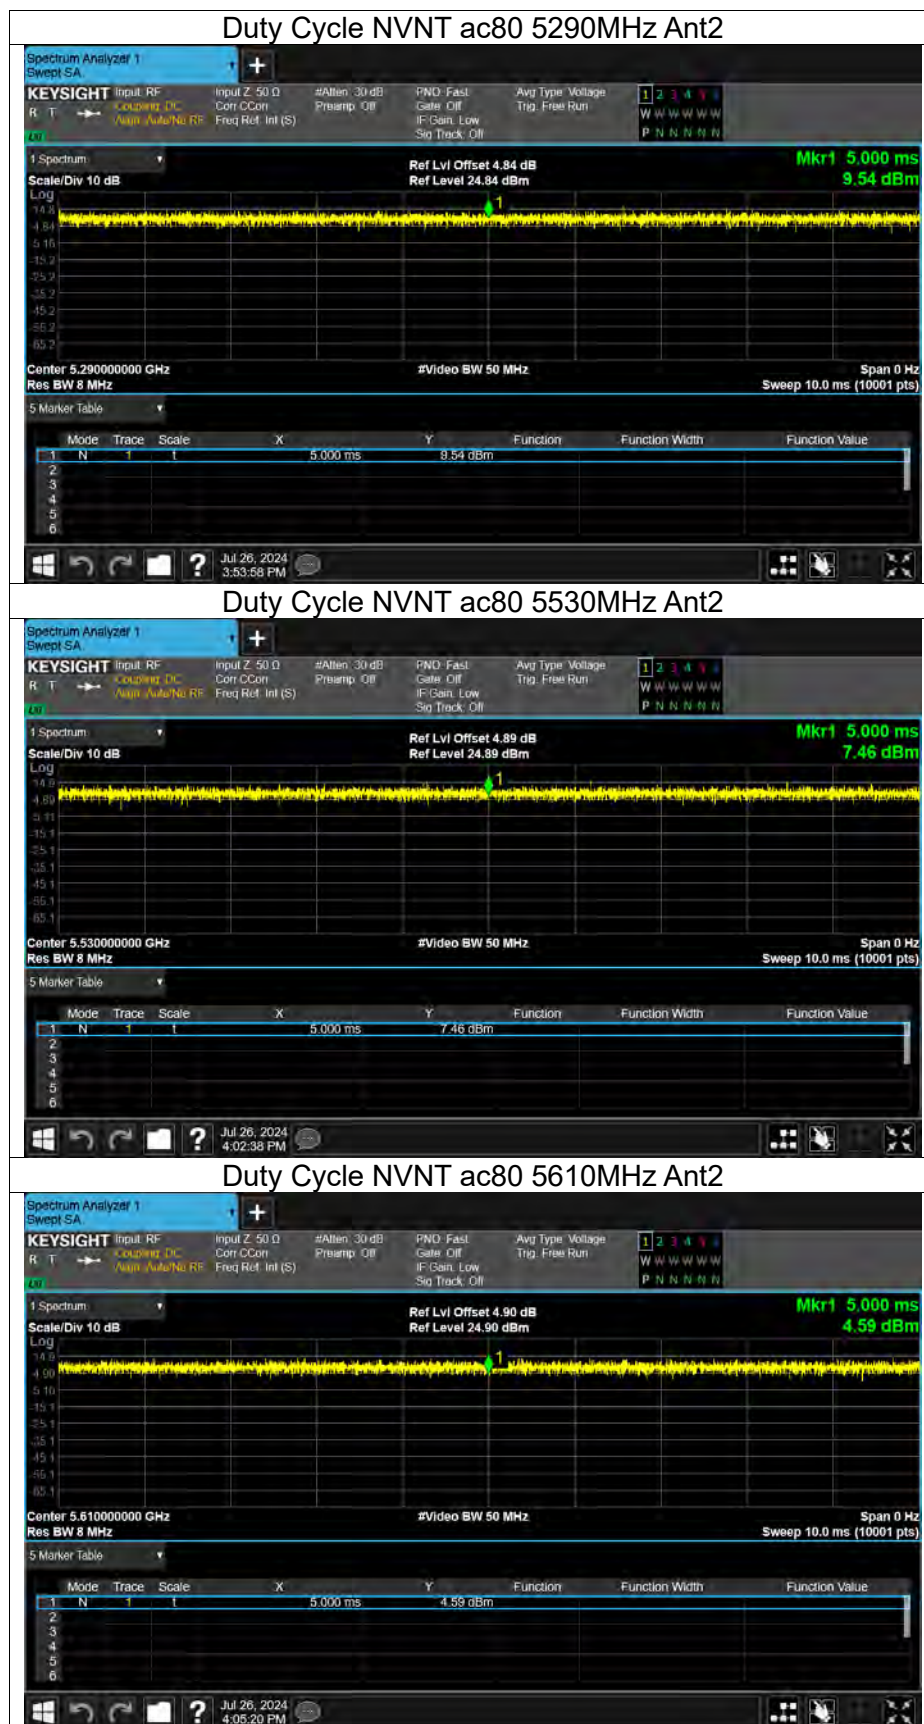


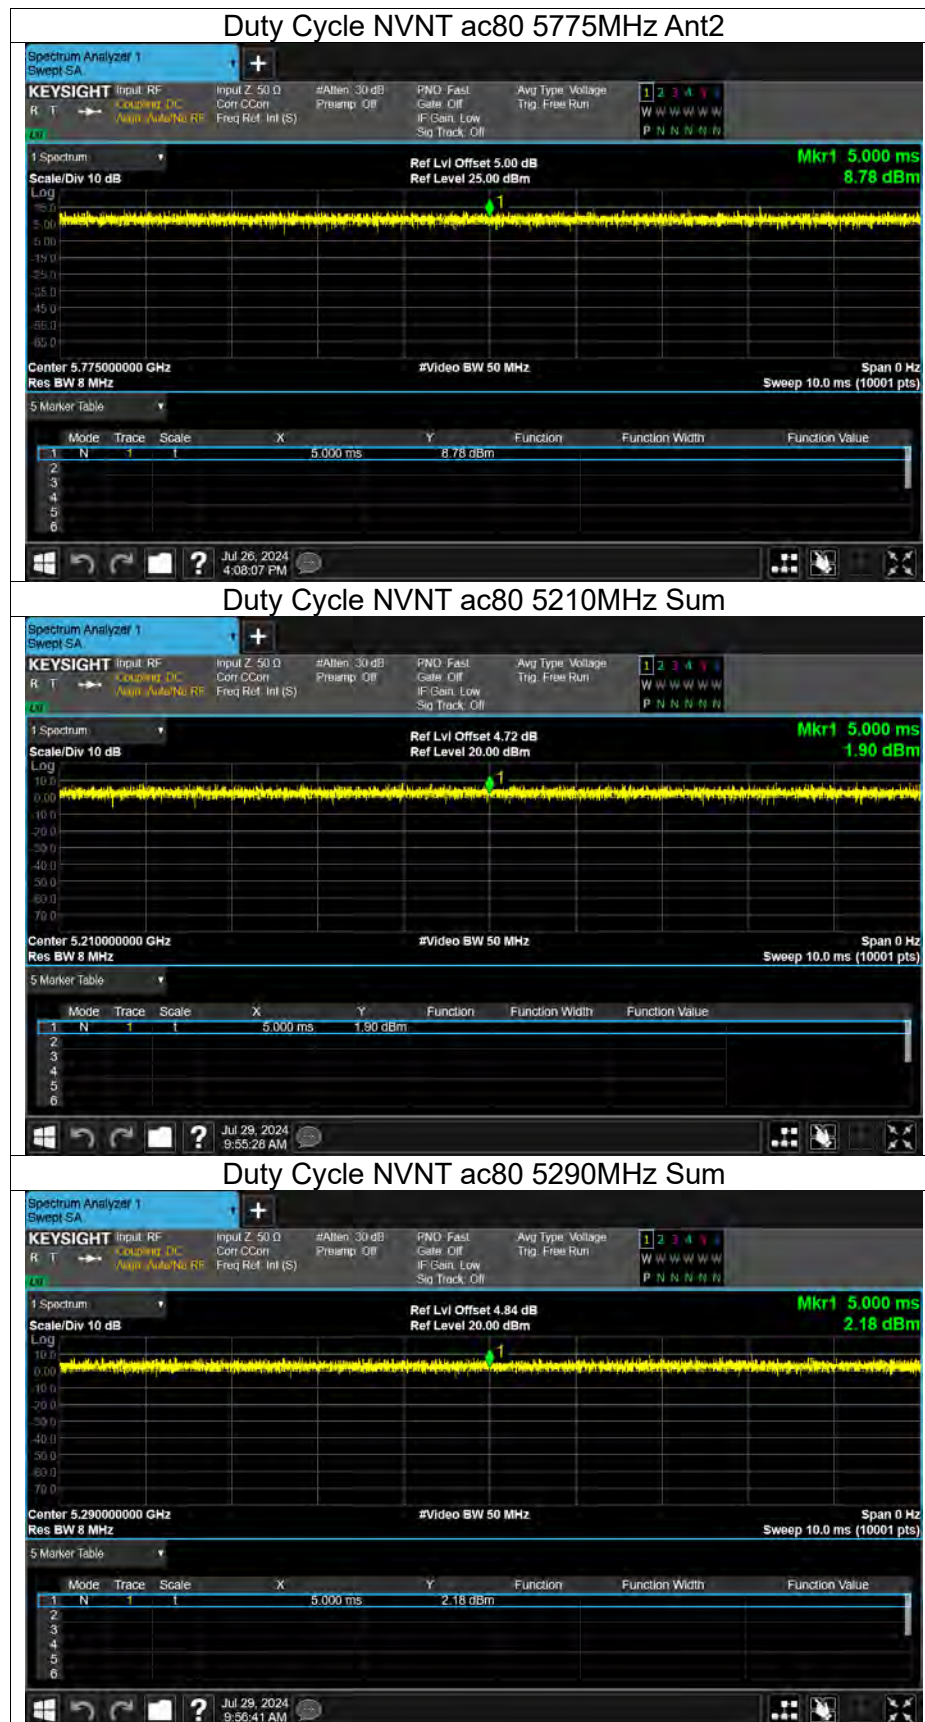


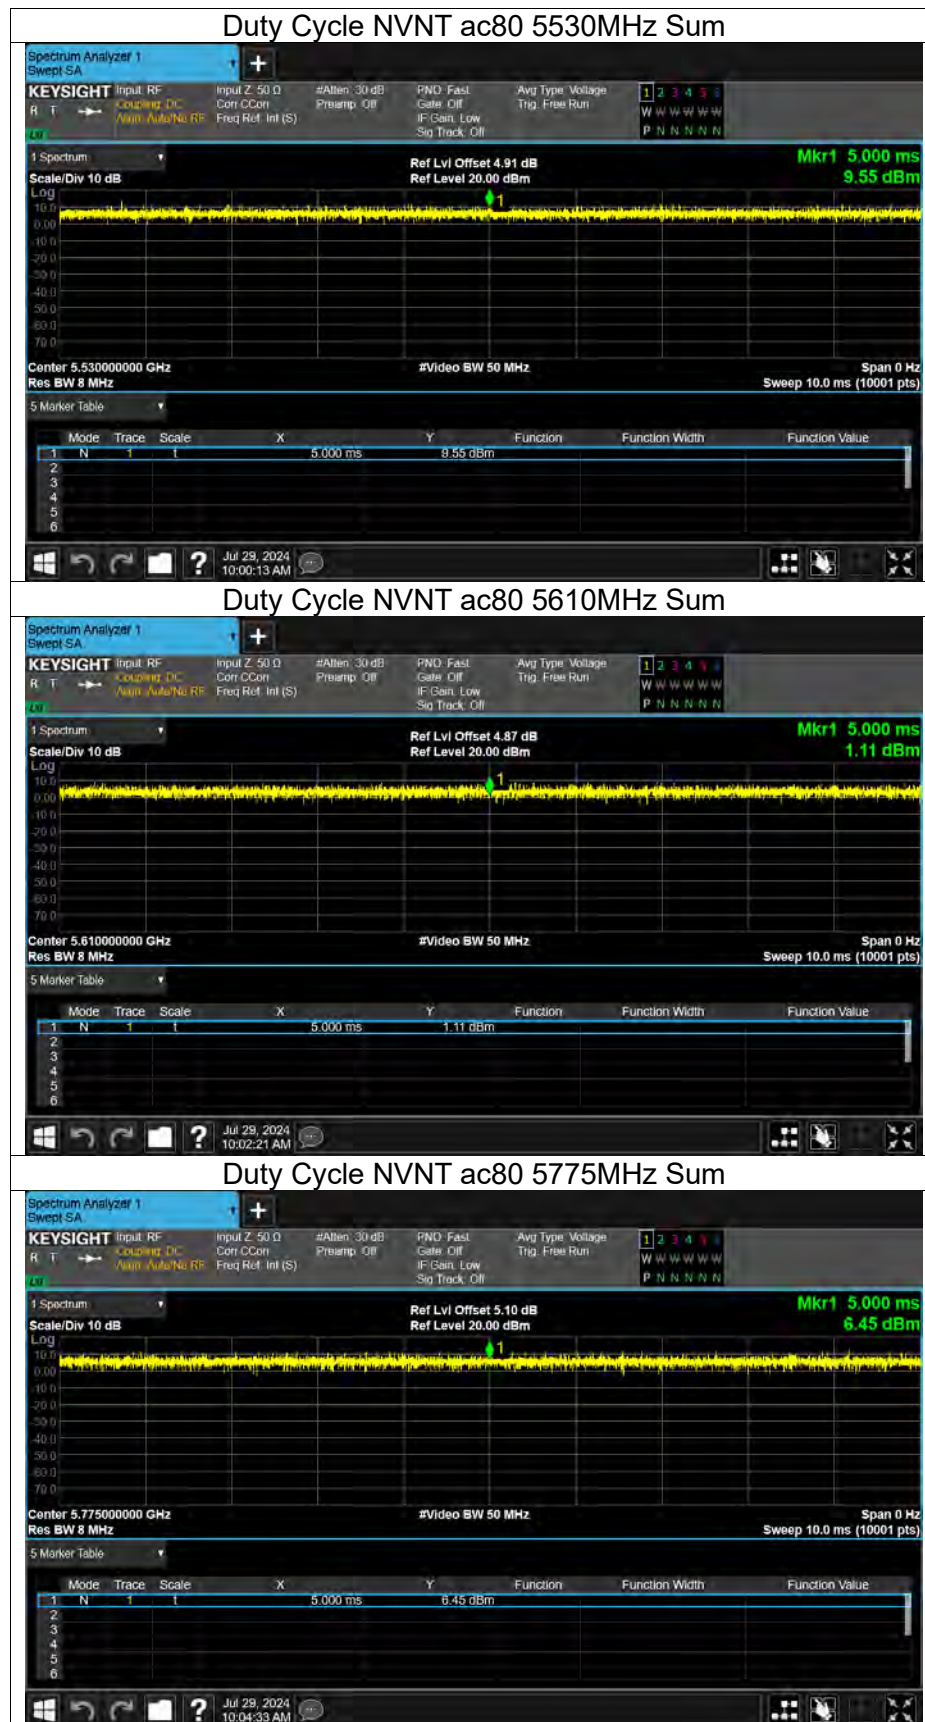


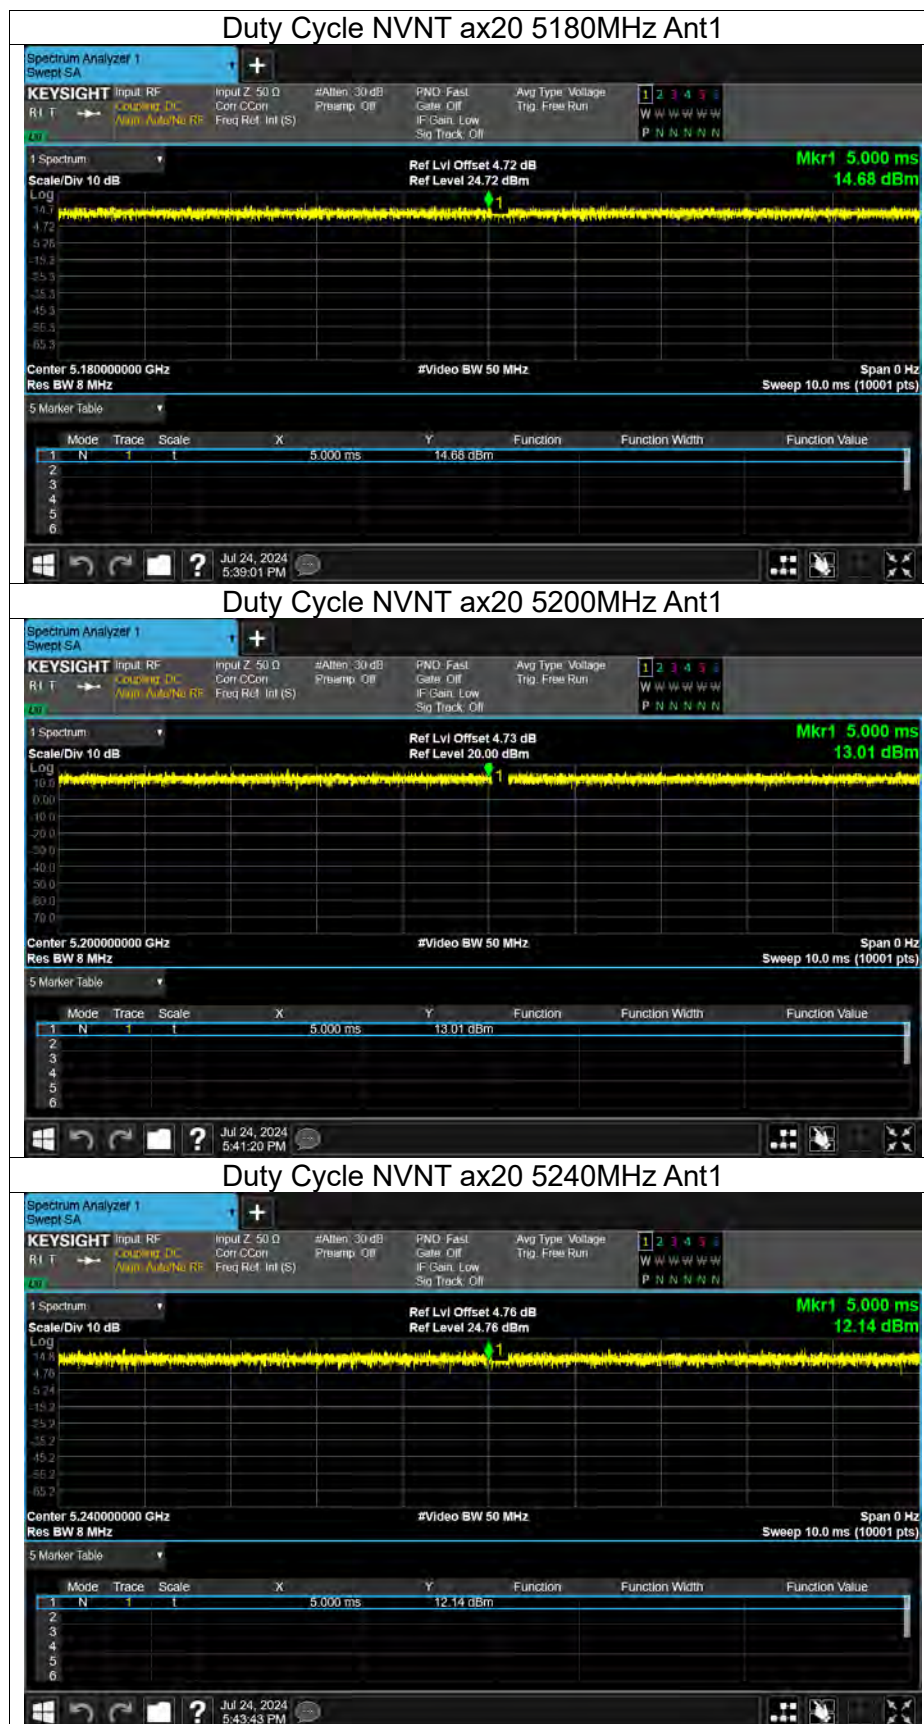


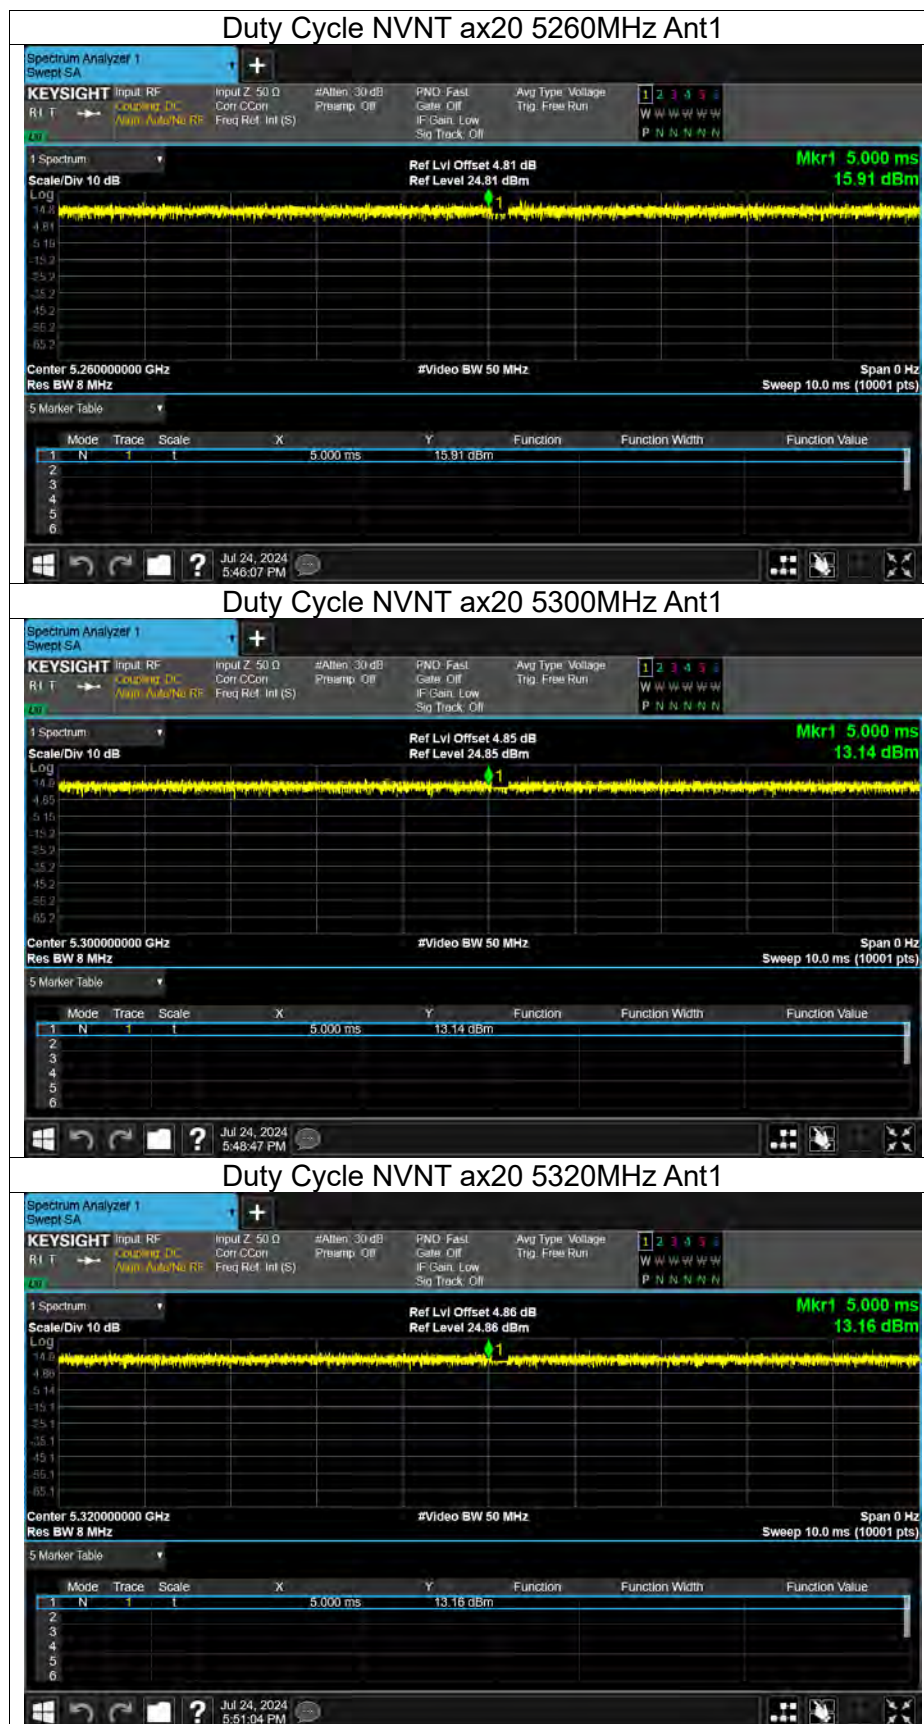


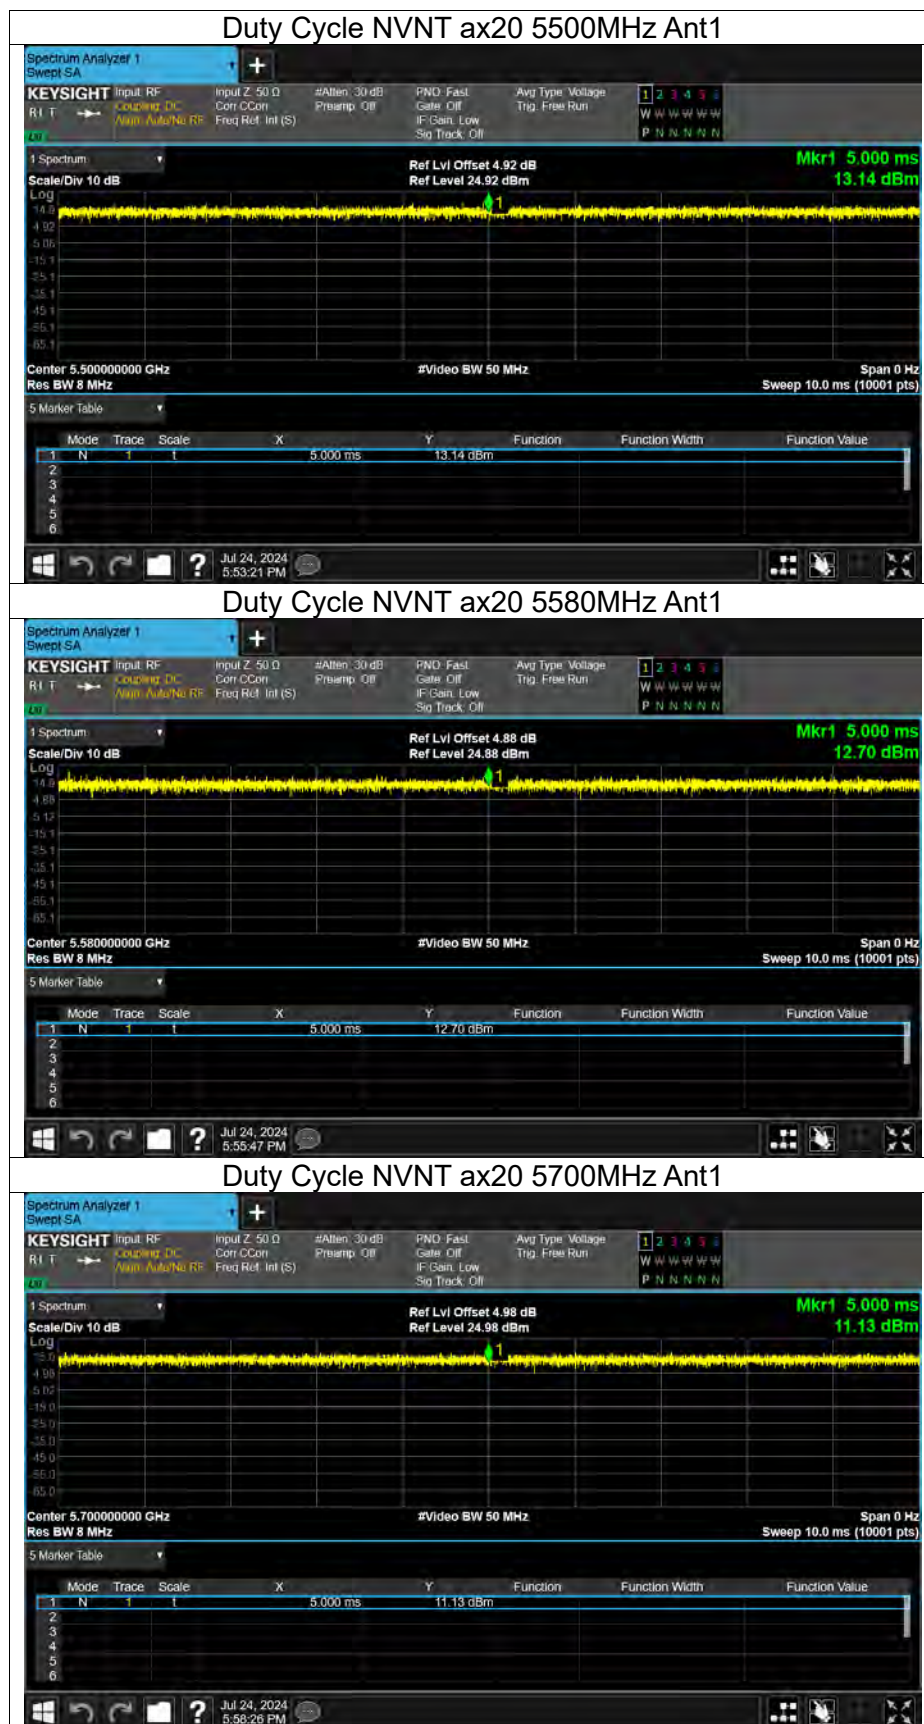


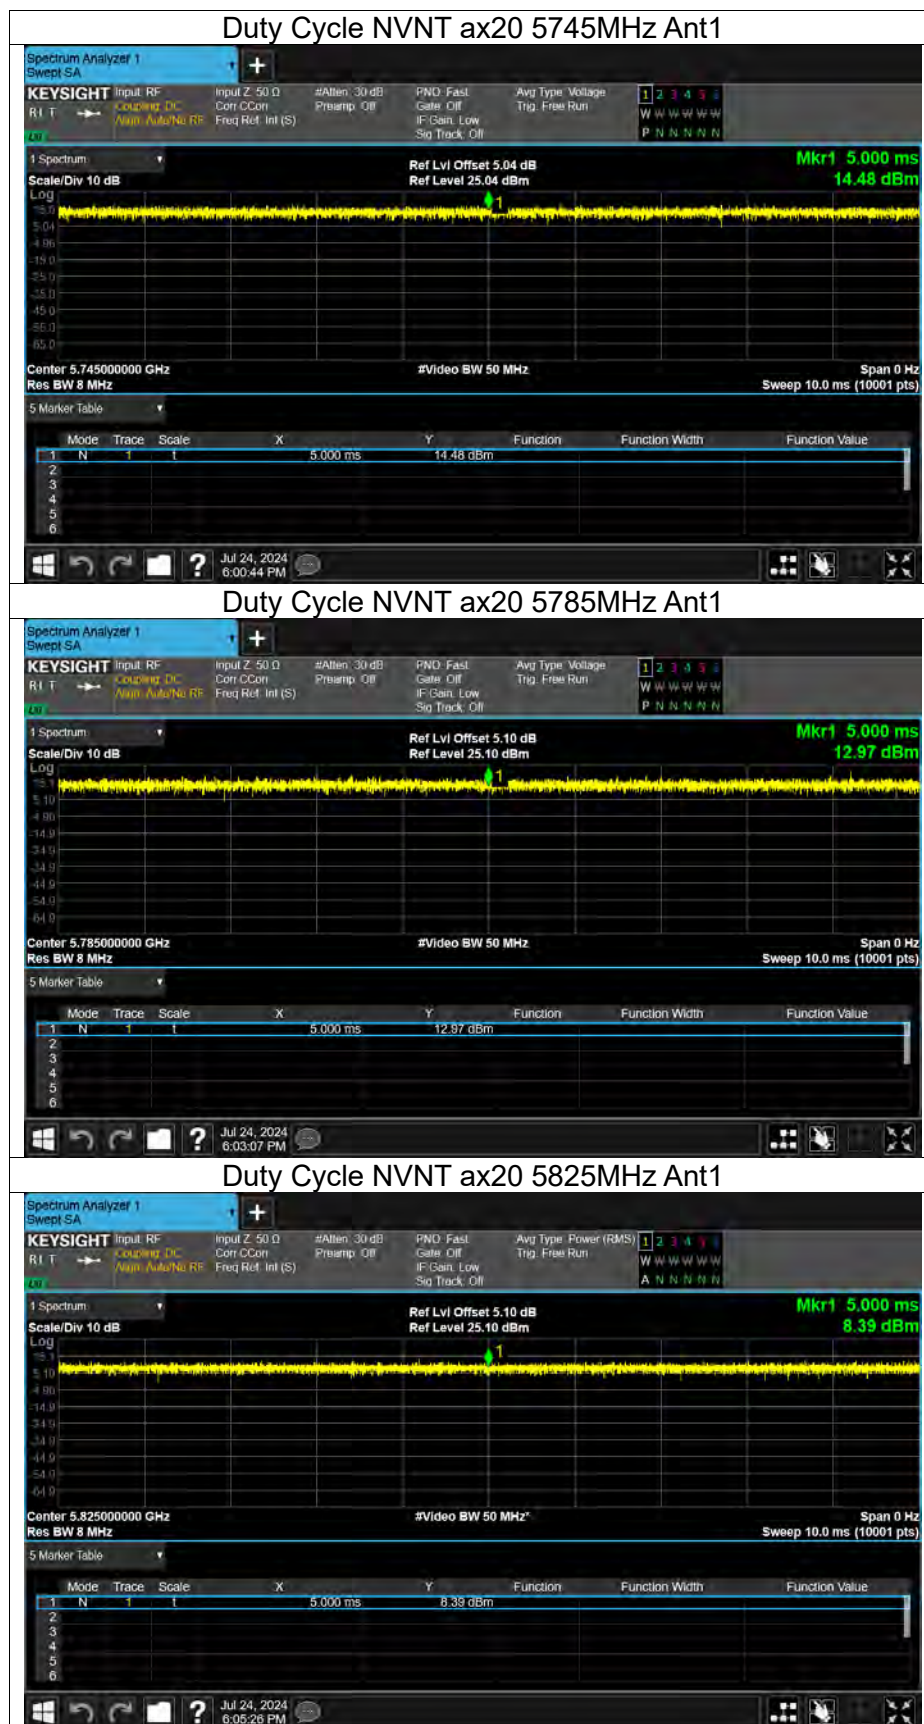

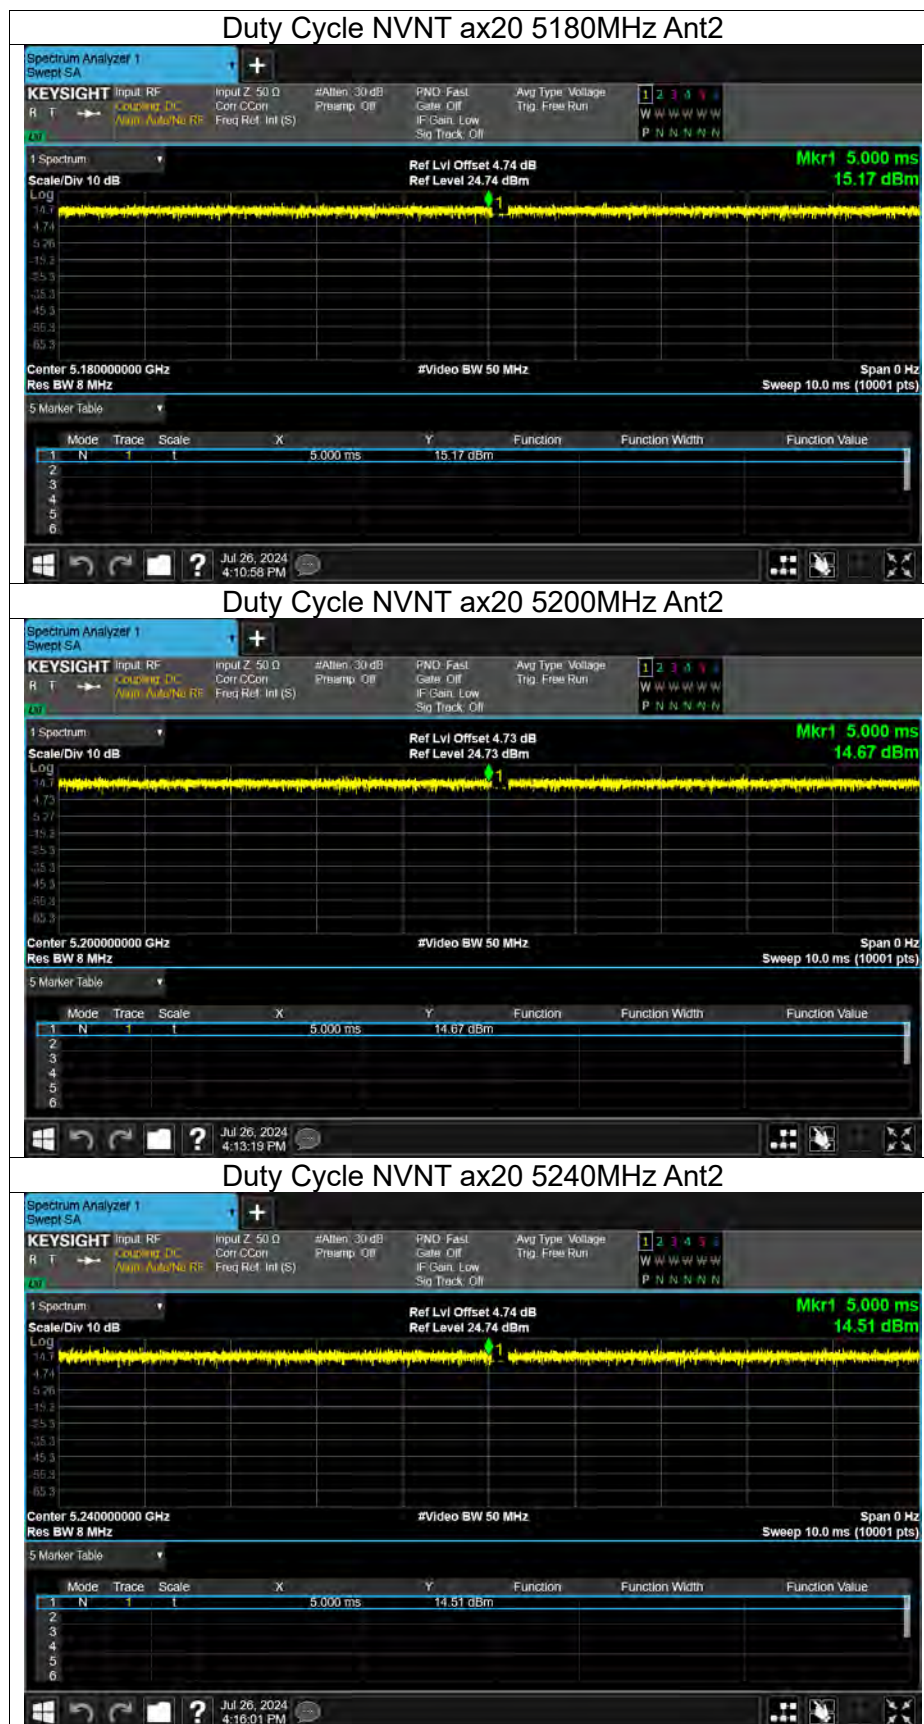


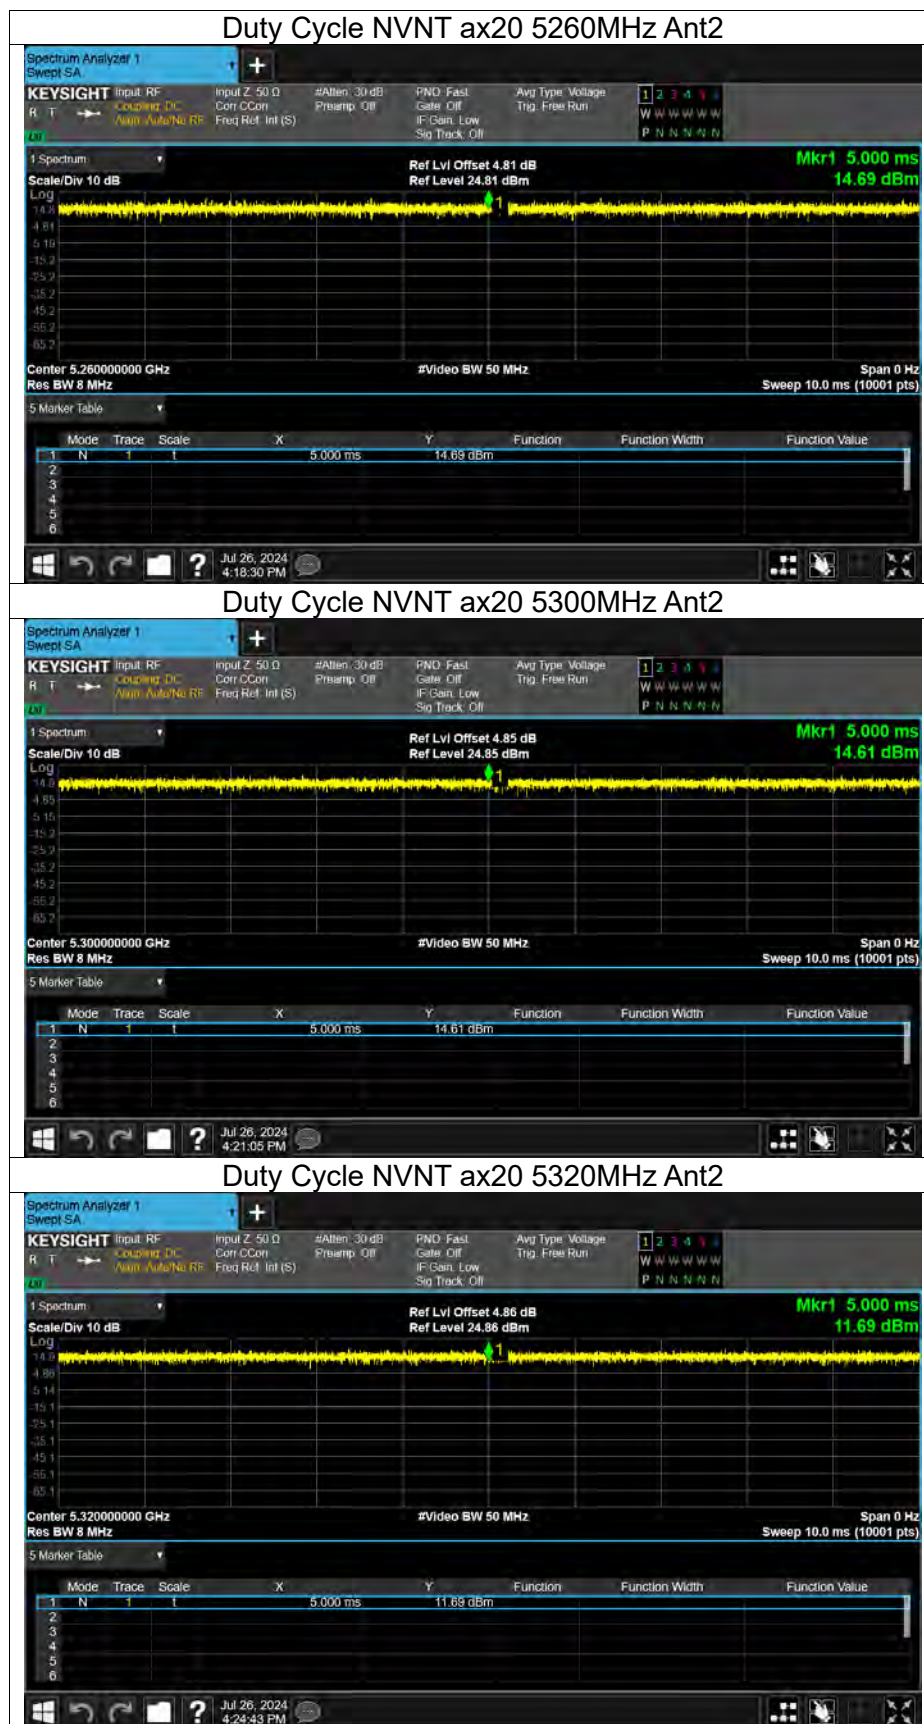


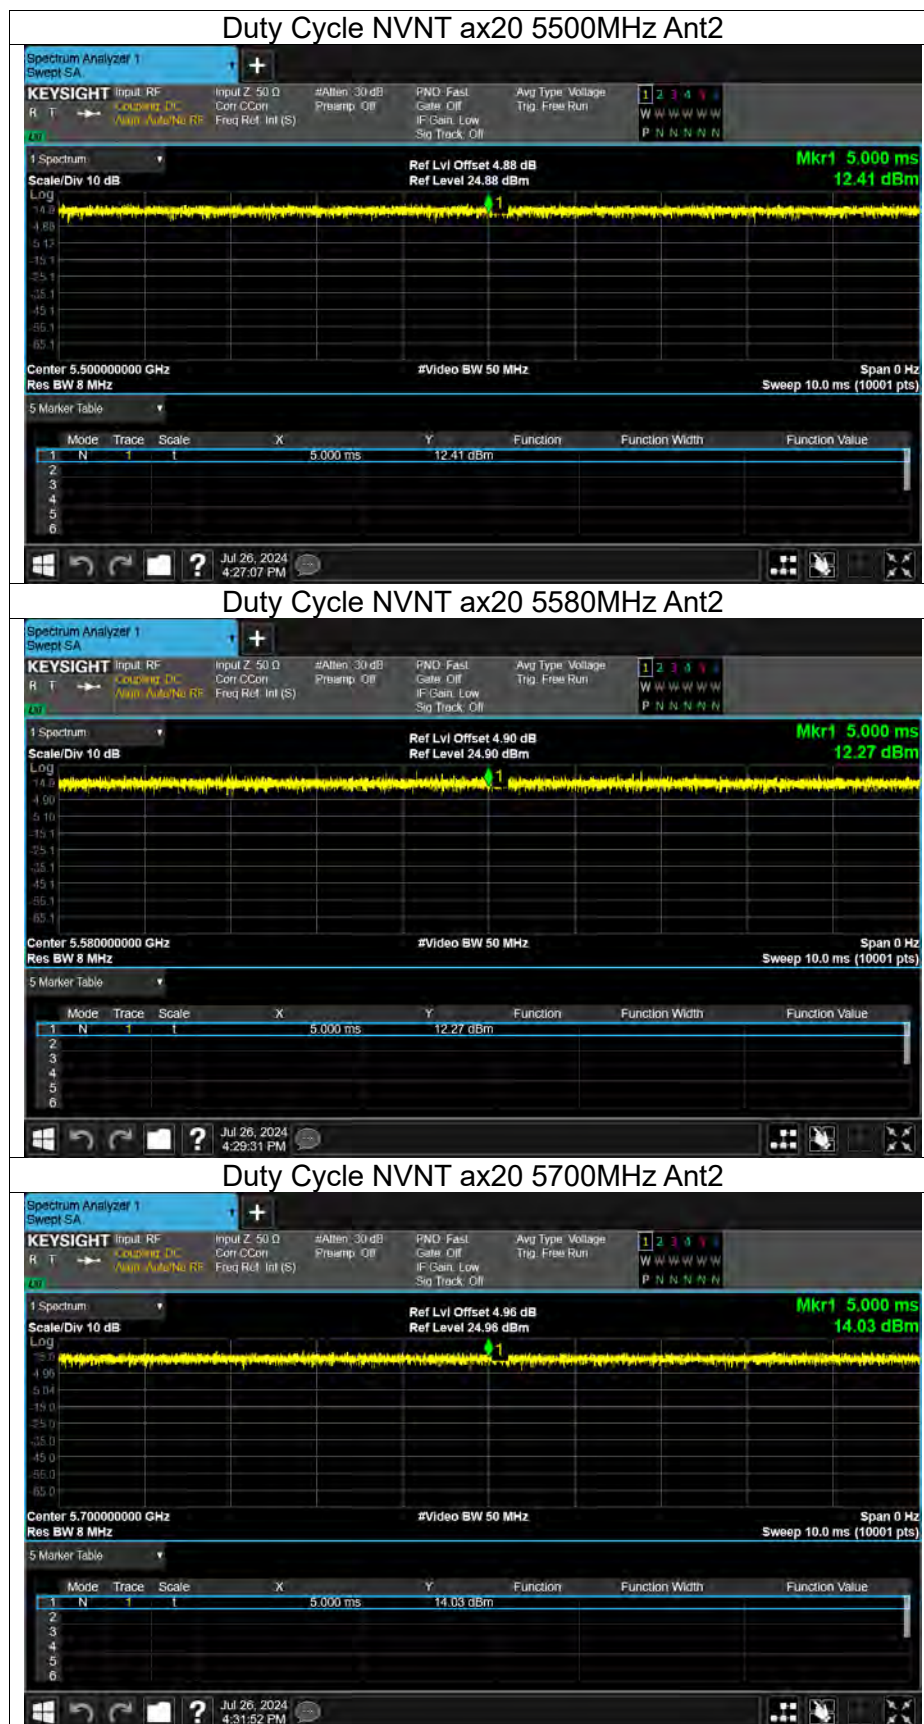


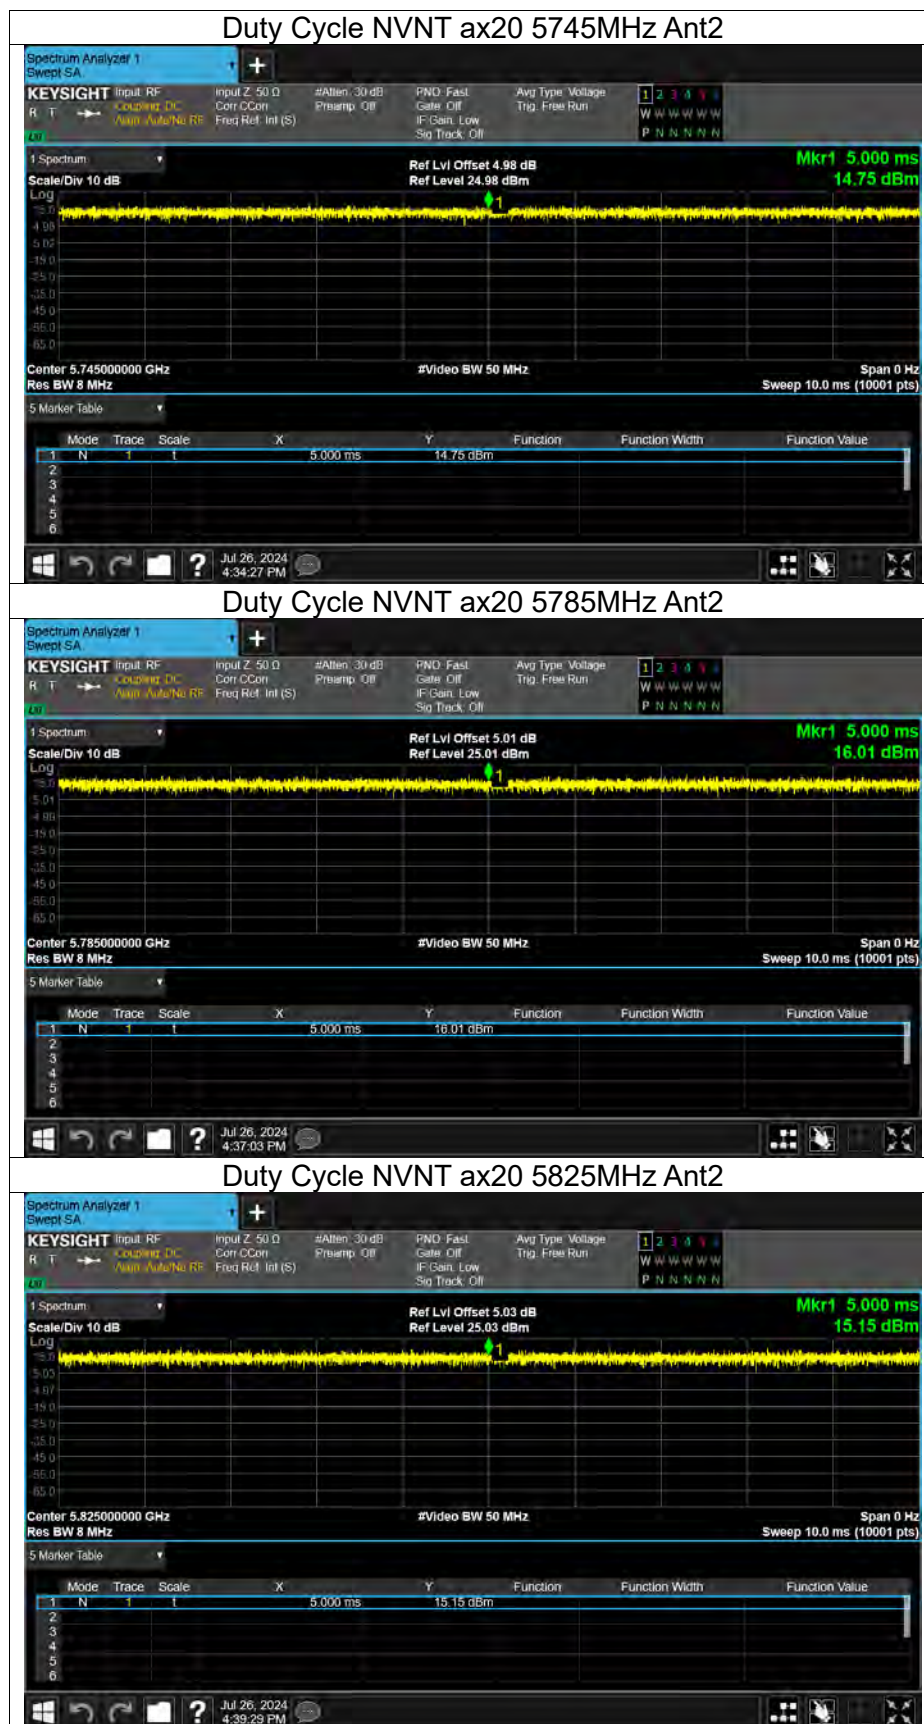





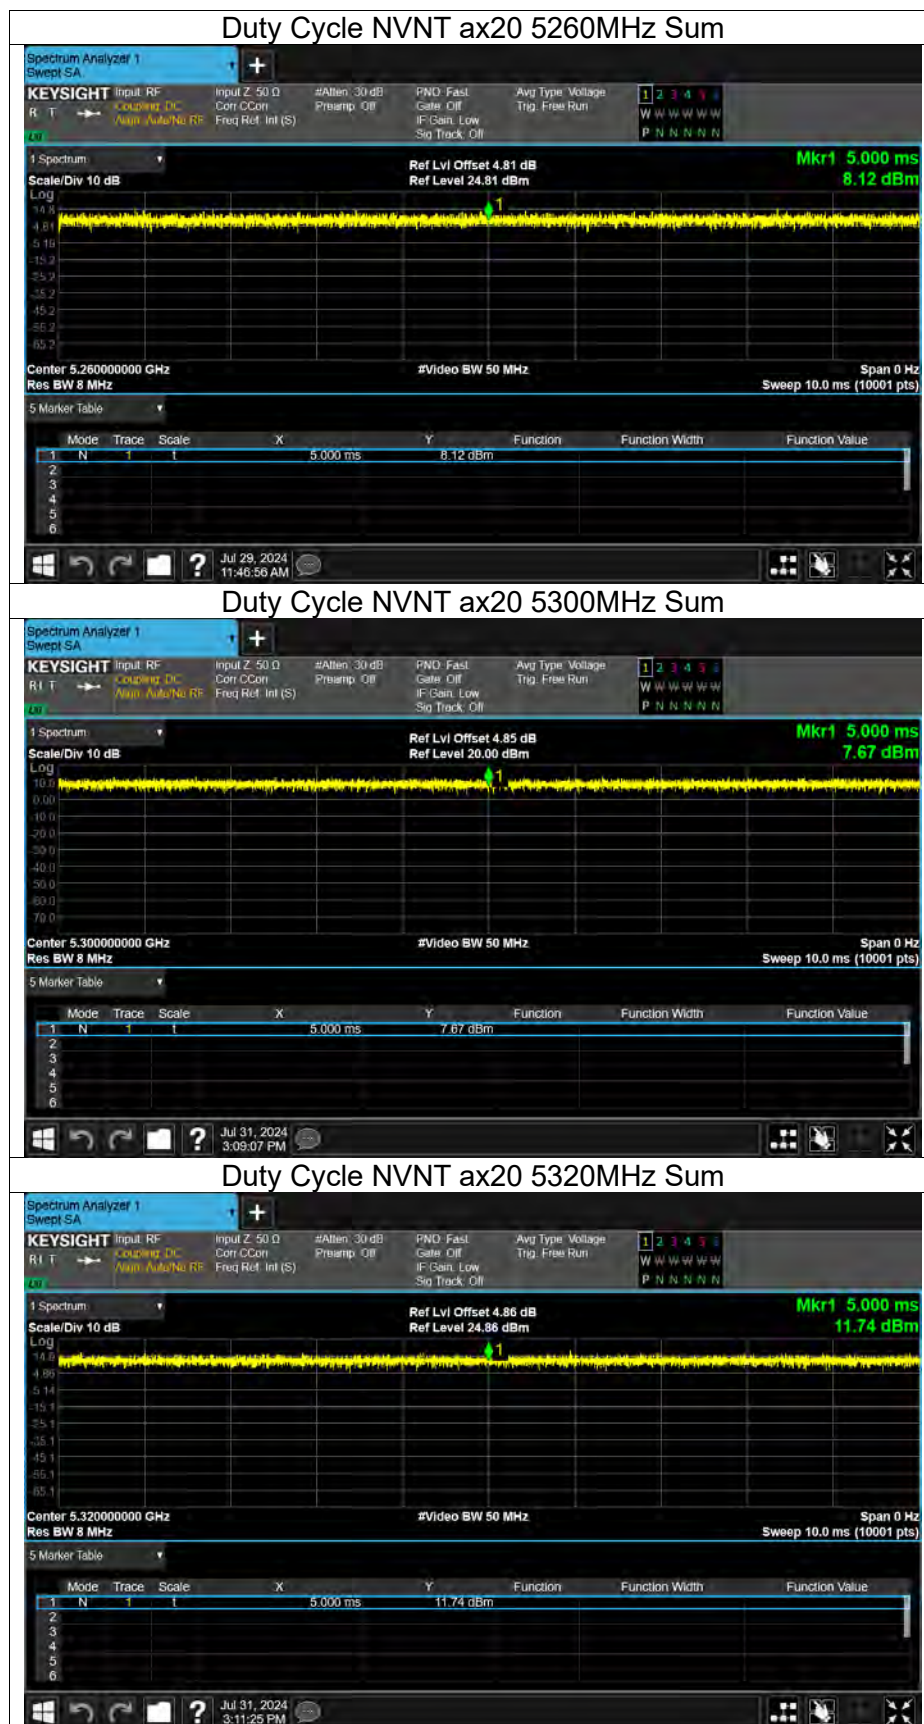


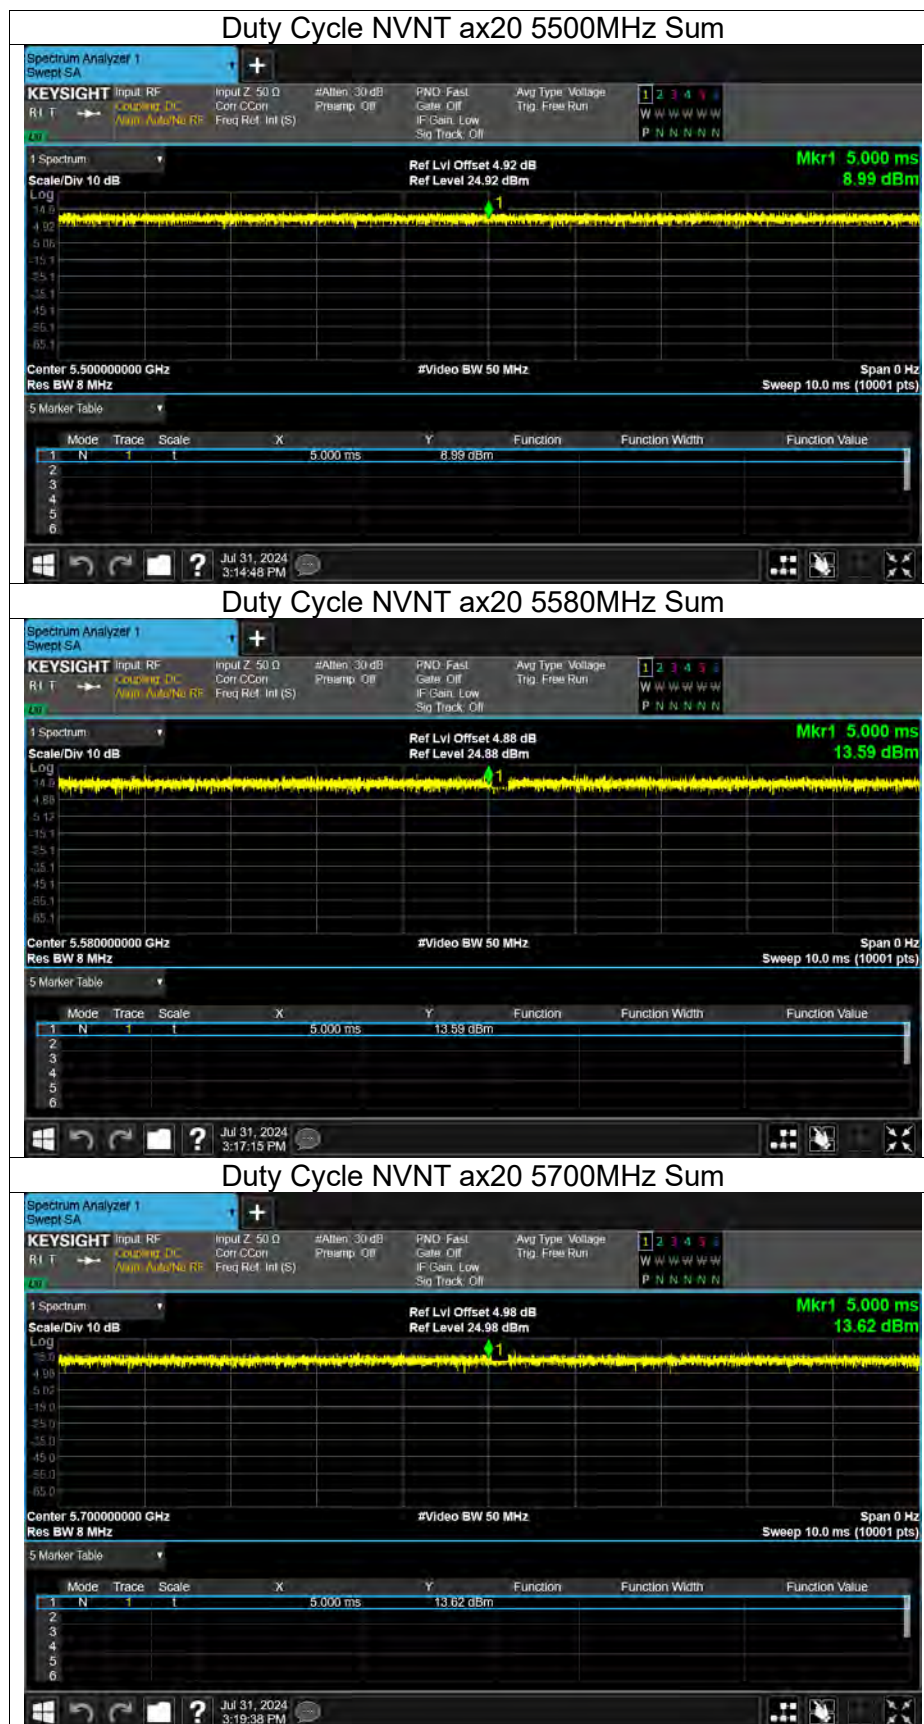


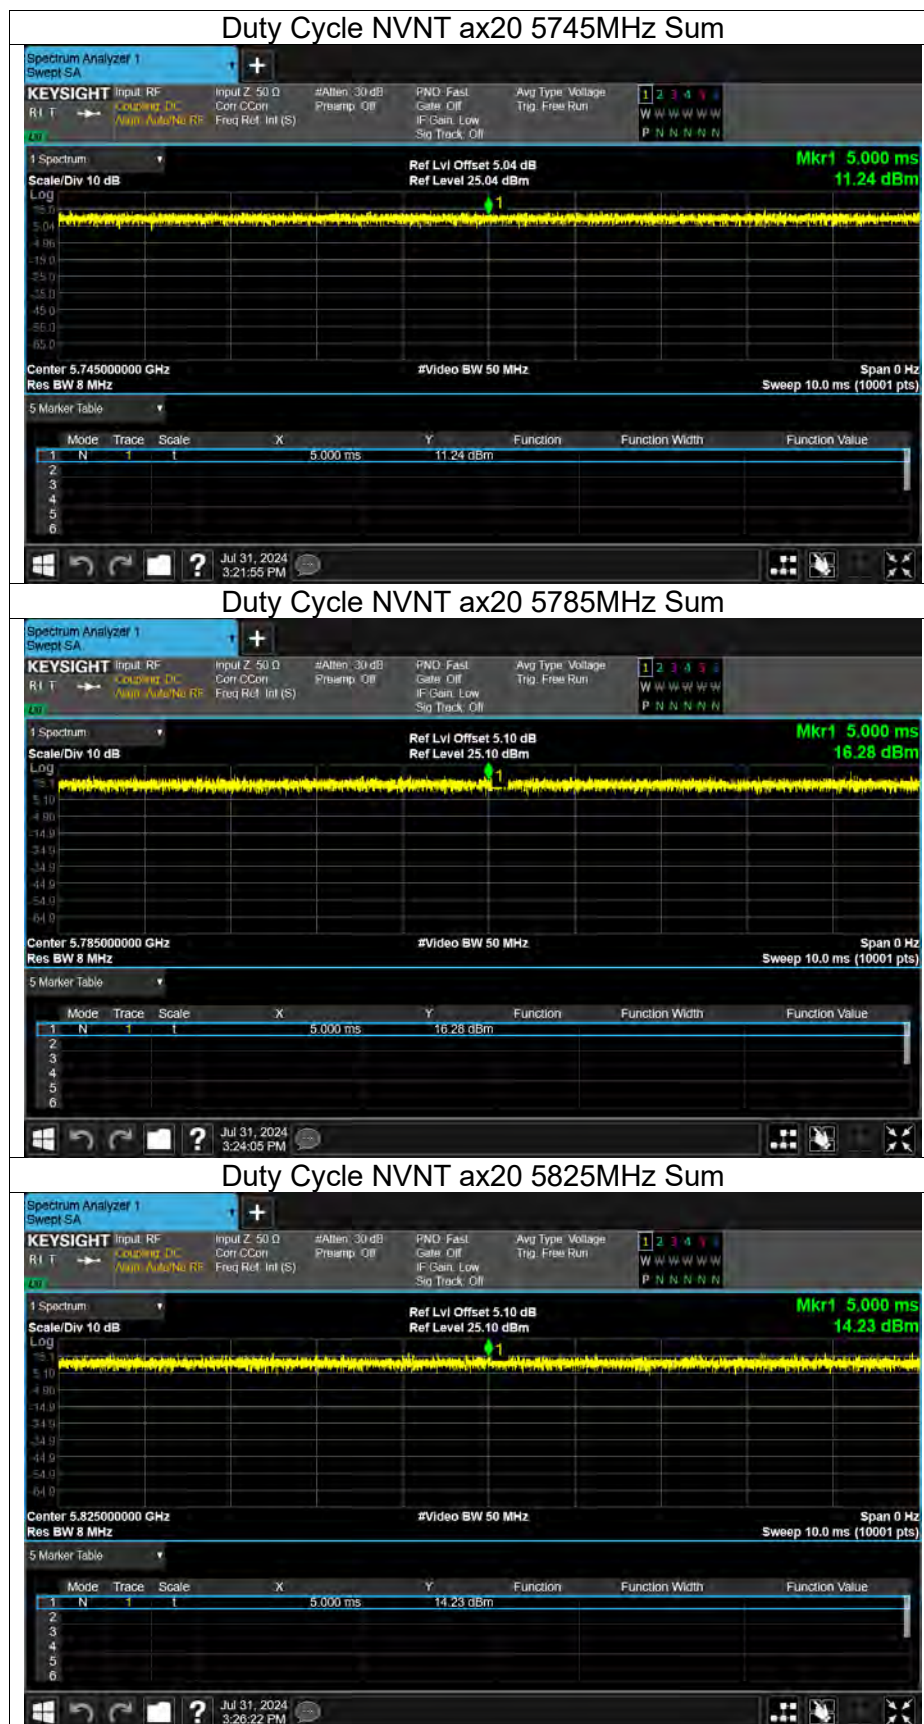

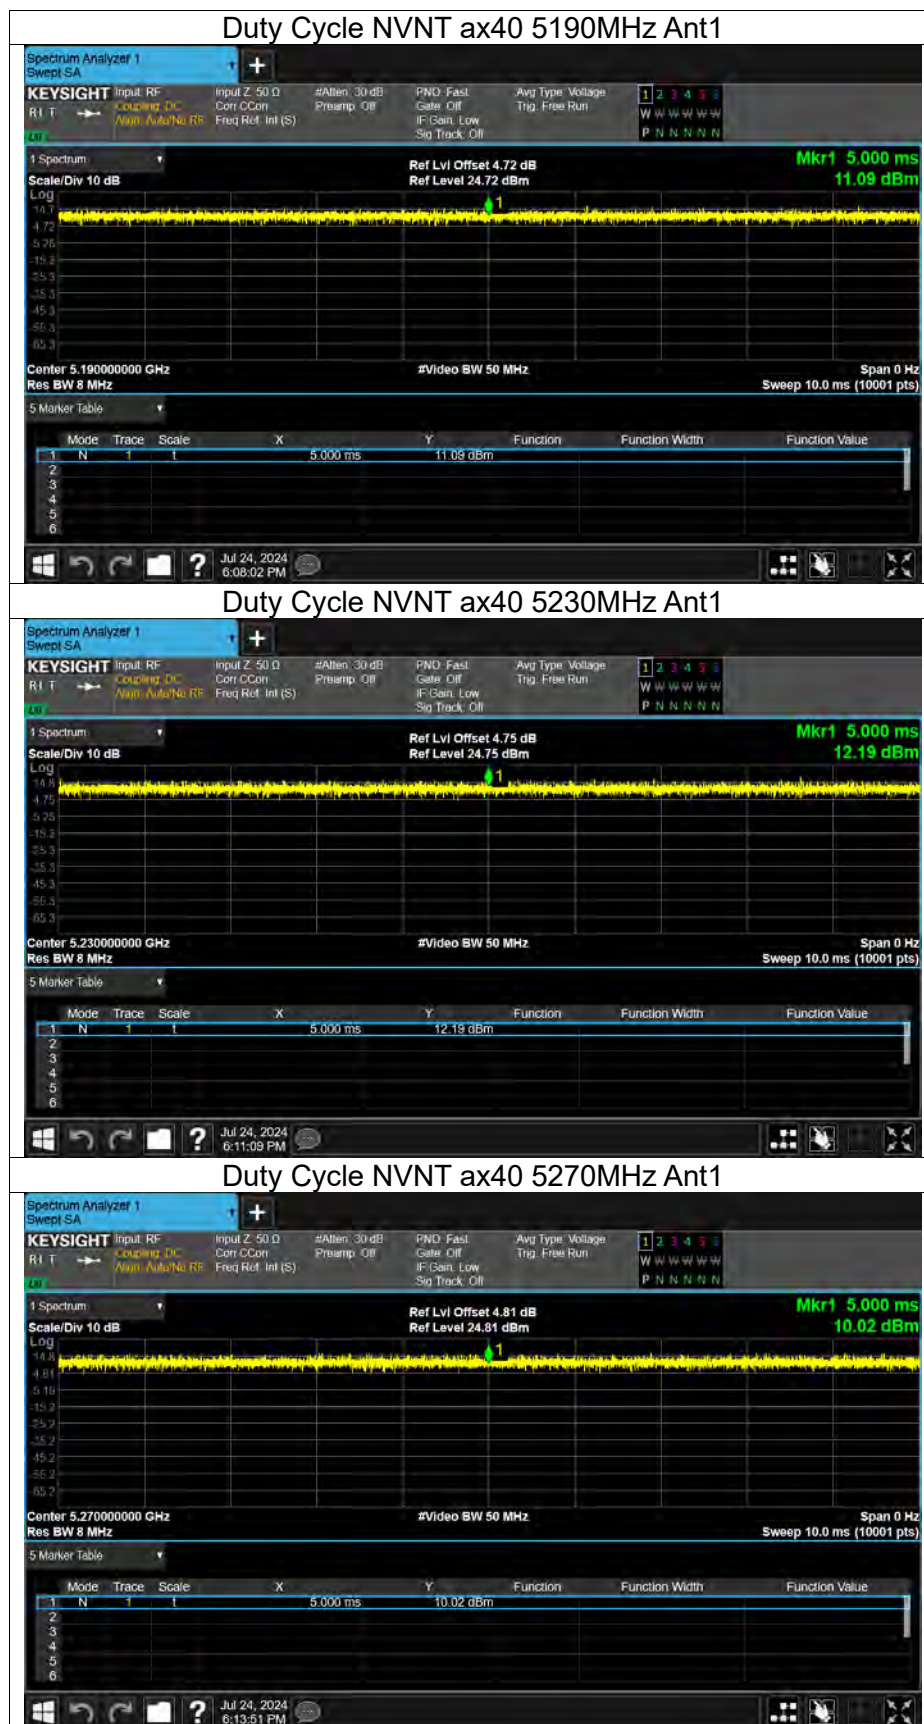

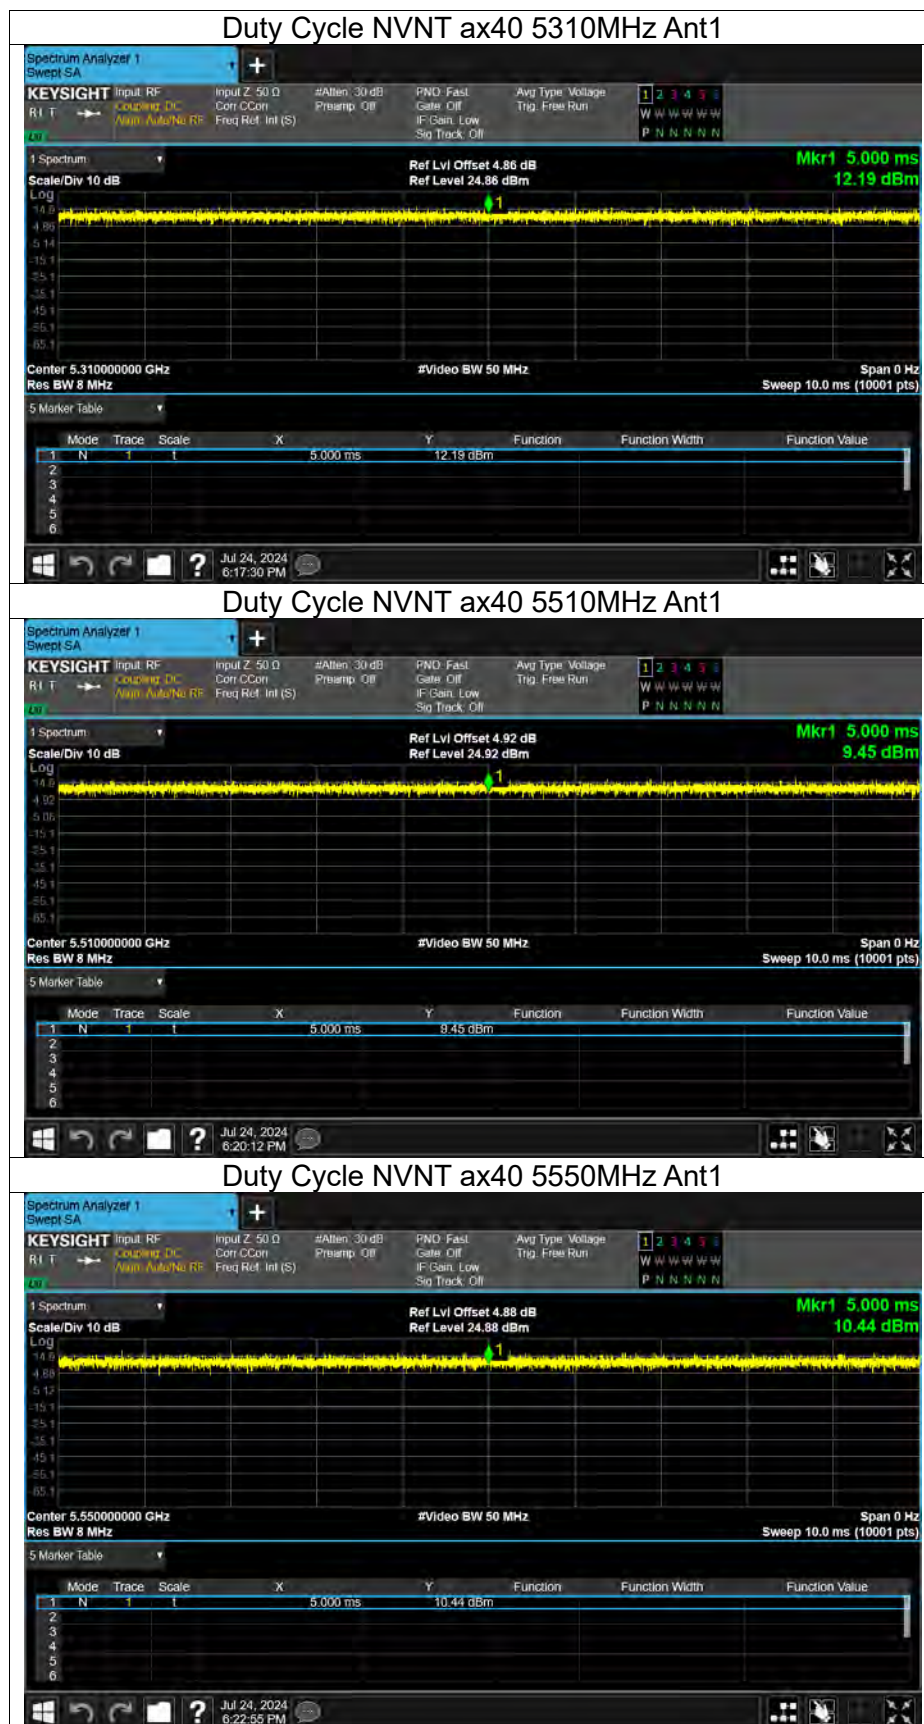

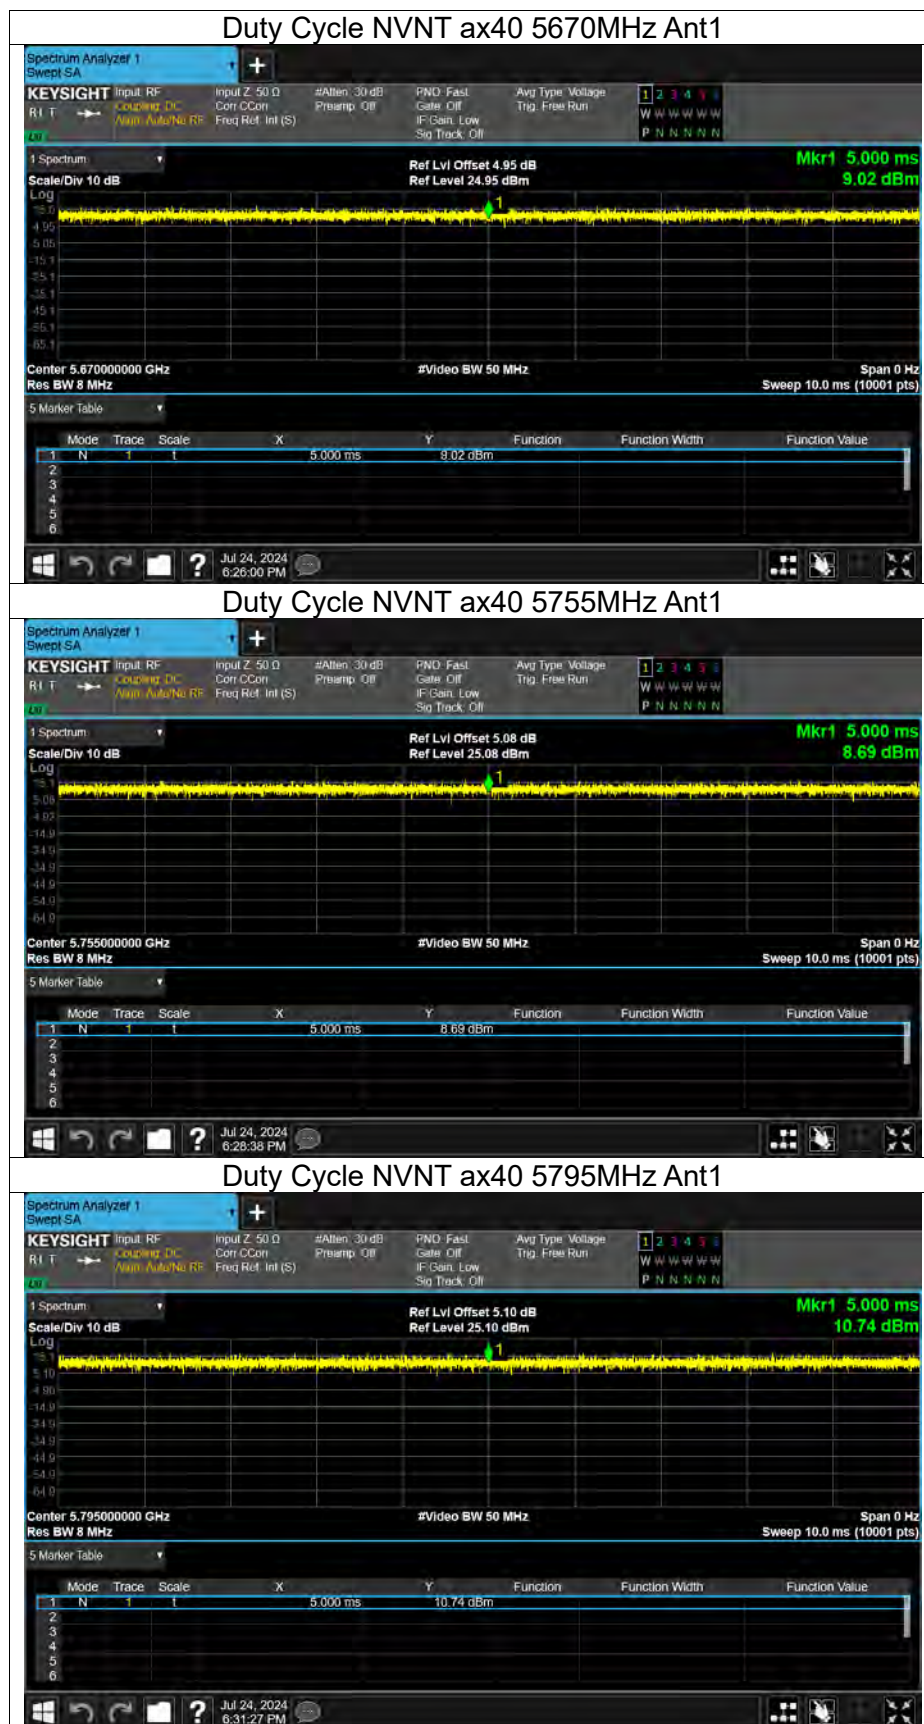

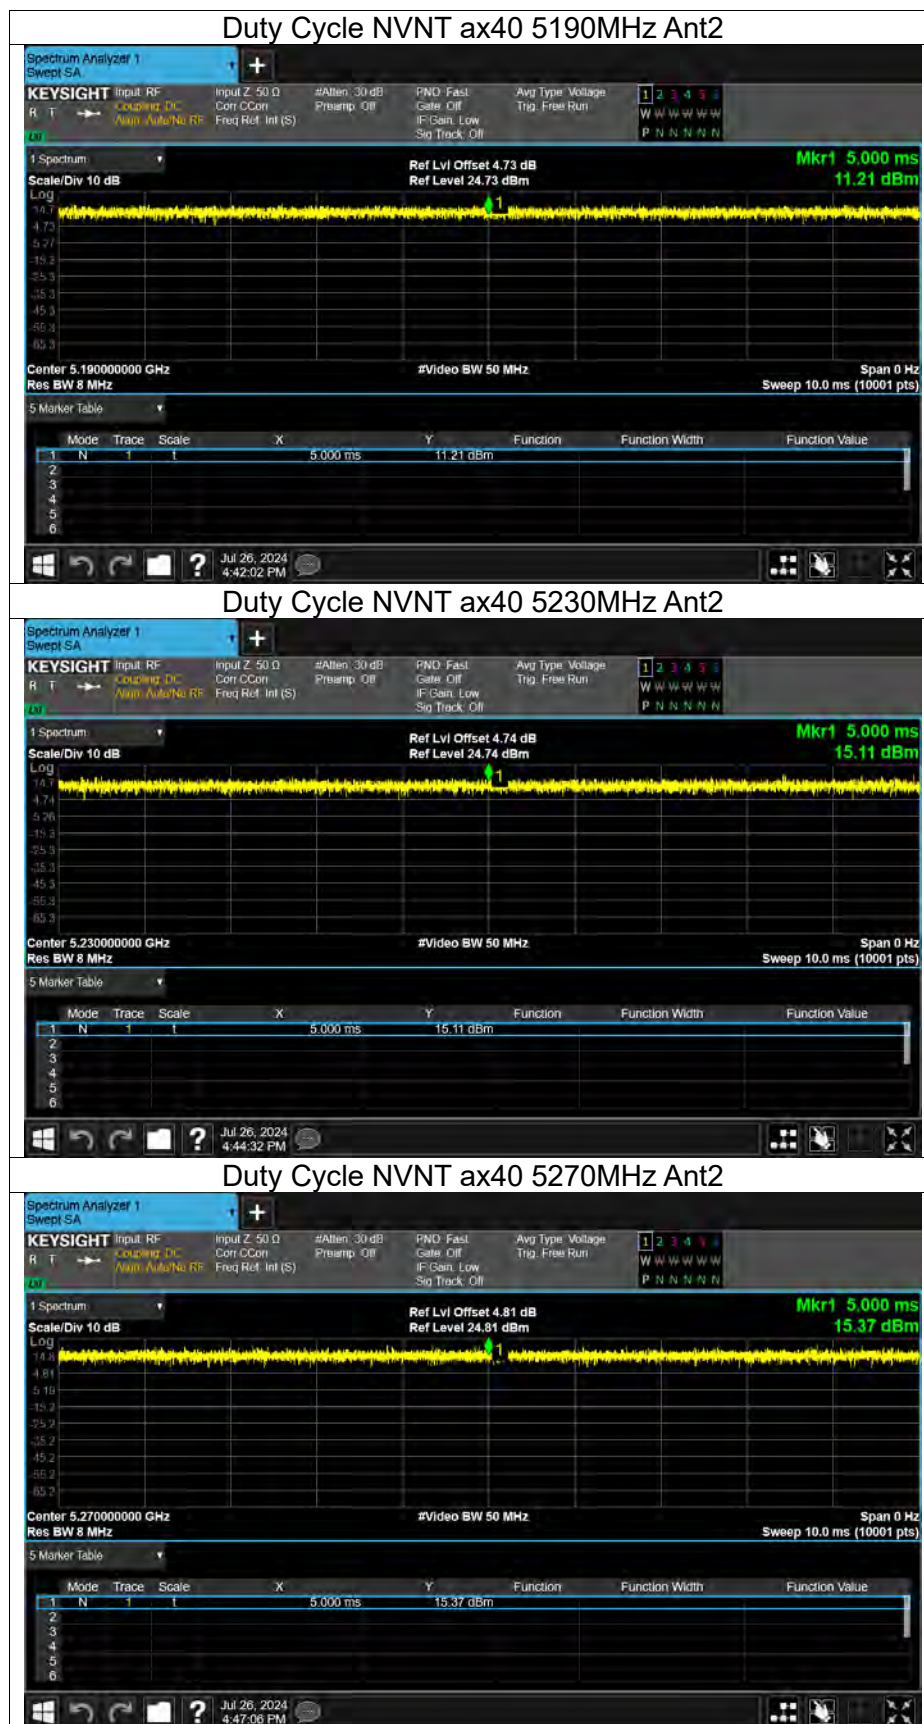



Duty Cycle NVNT ax40 5310MHz Ant2



Duty Cycle NVNT ax40 5510MHz Ant2



Duty Cycle NVNT ax40 5550MHz Ant2






Duty Cycle NVNT ax40 5670MHz Ant2





Duty Cycle NVNT ax40 5755MHz Ant2

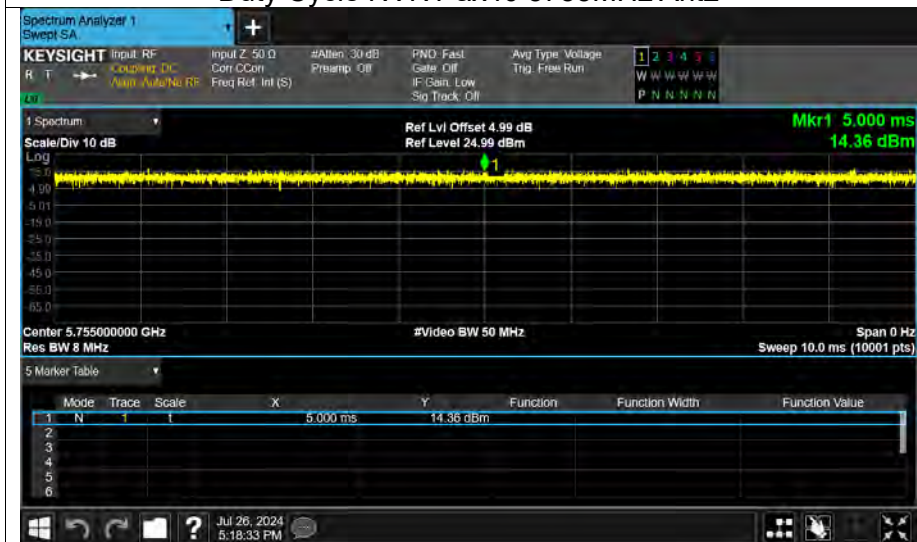



Duty Cycle NVNT ax40 5795MHz Ant2




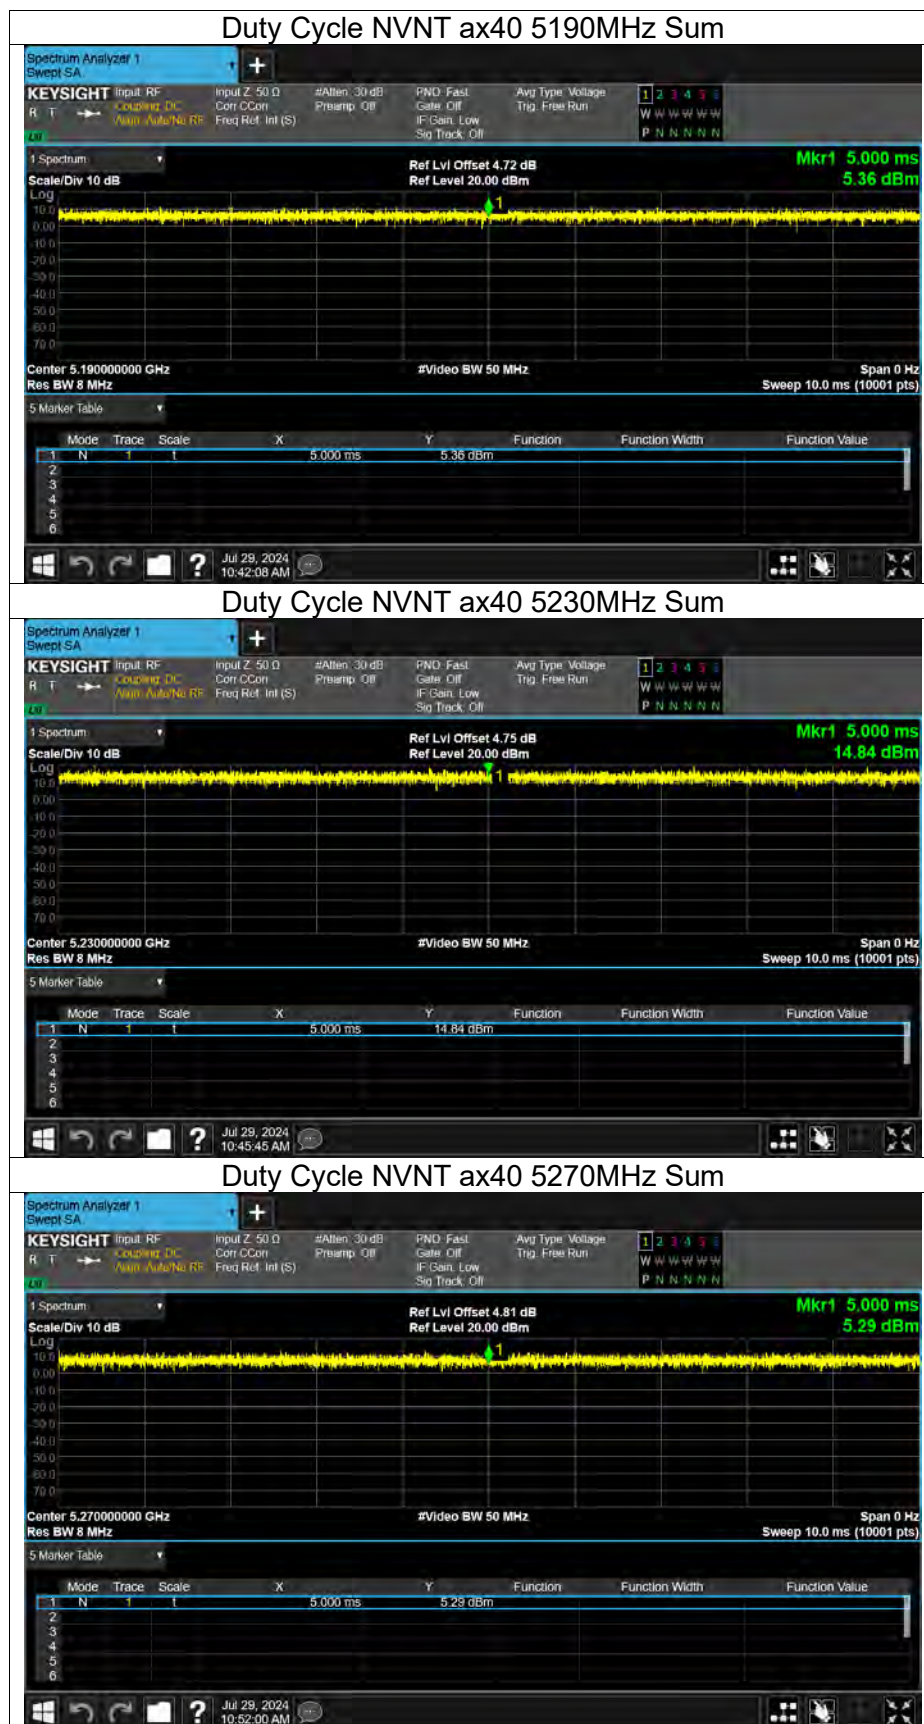


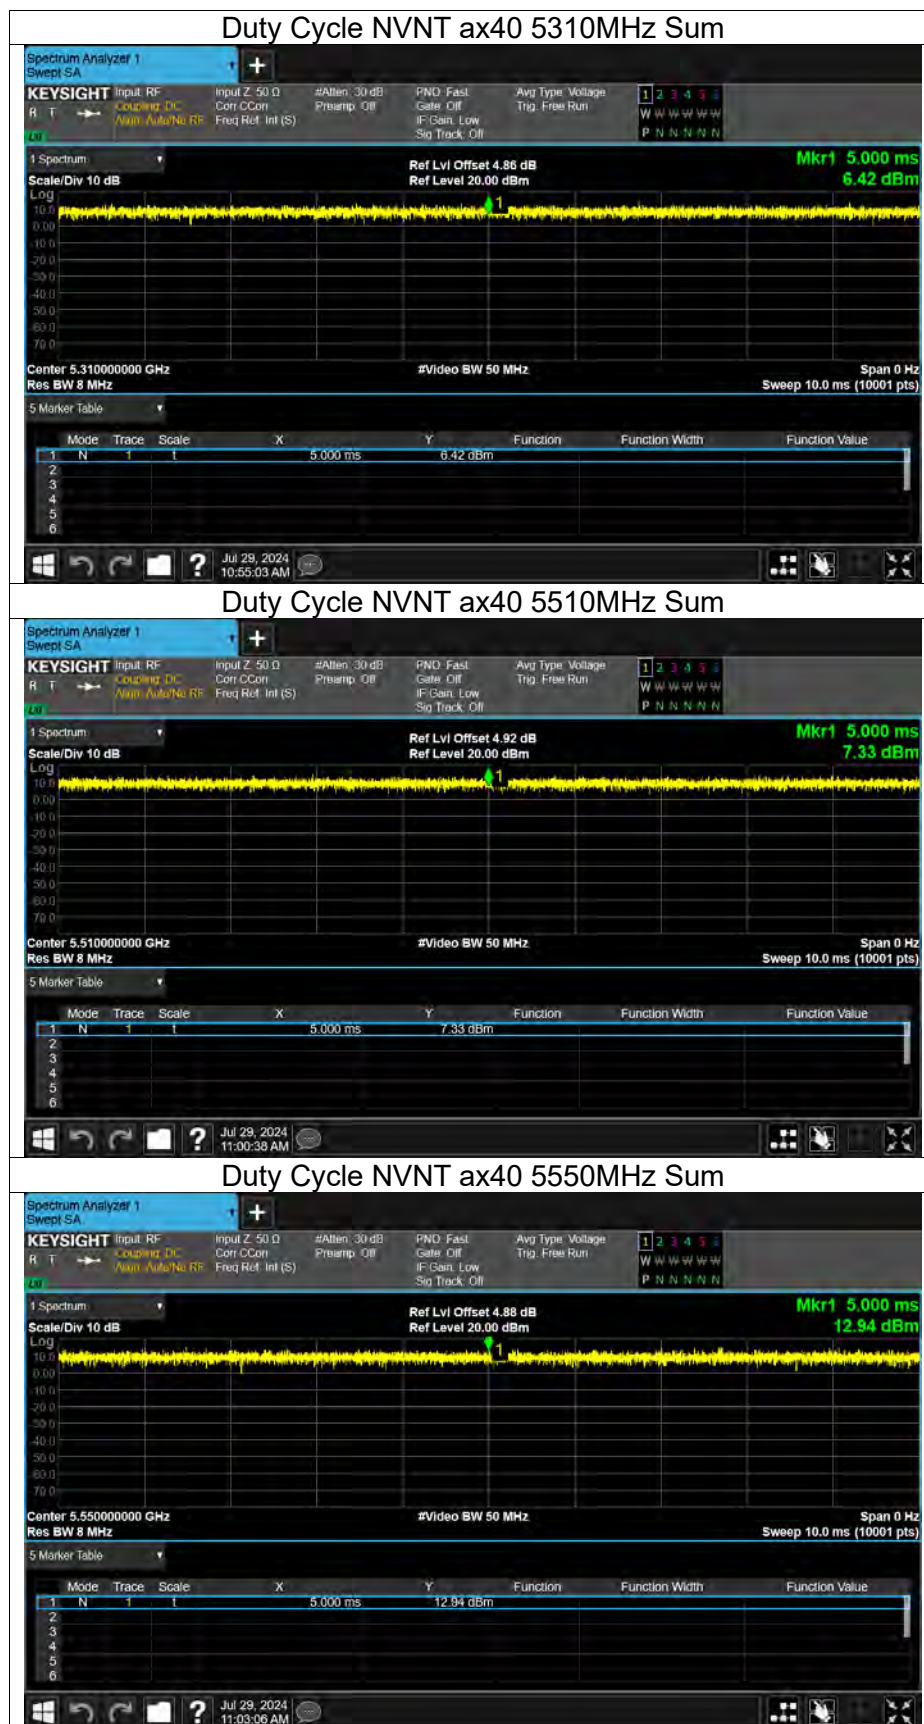


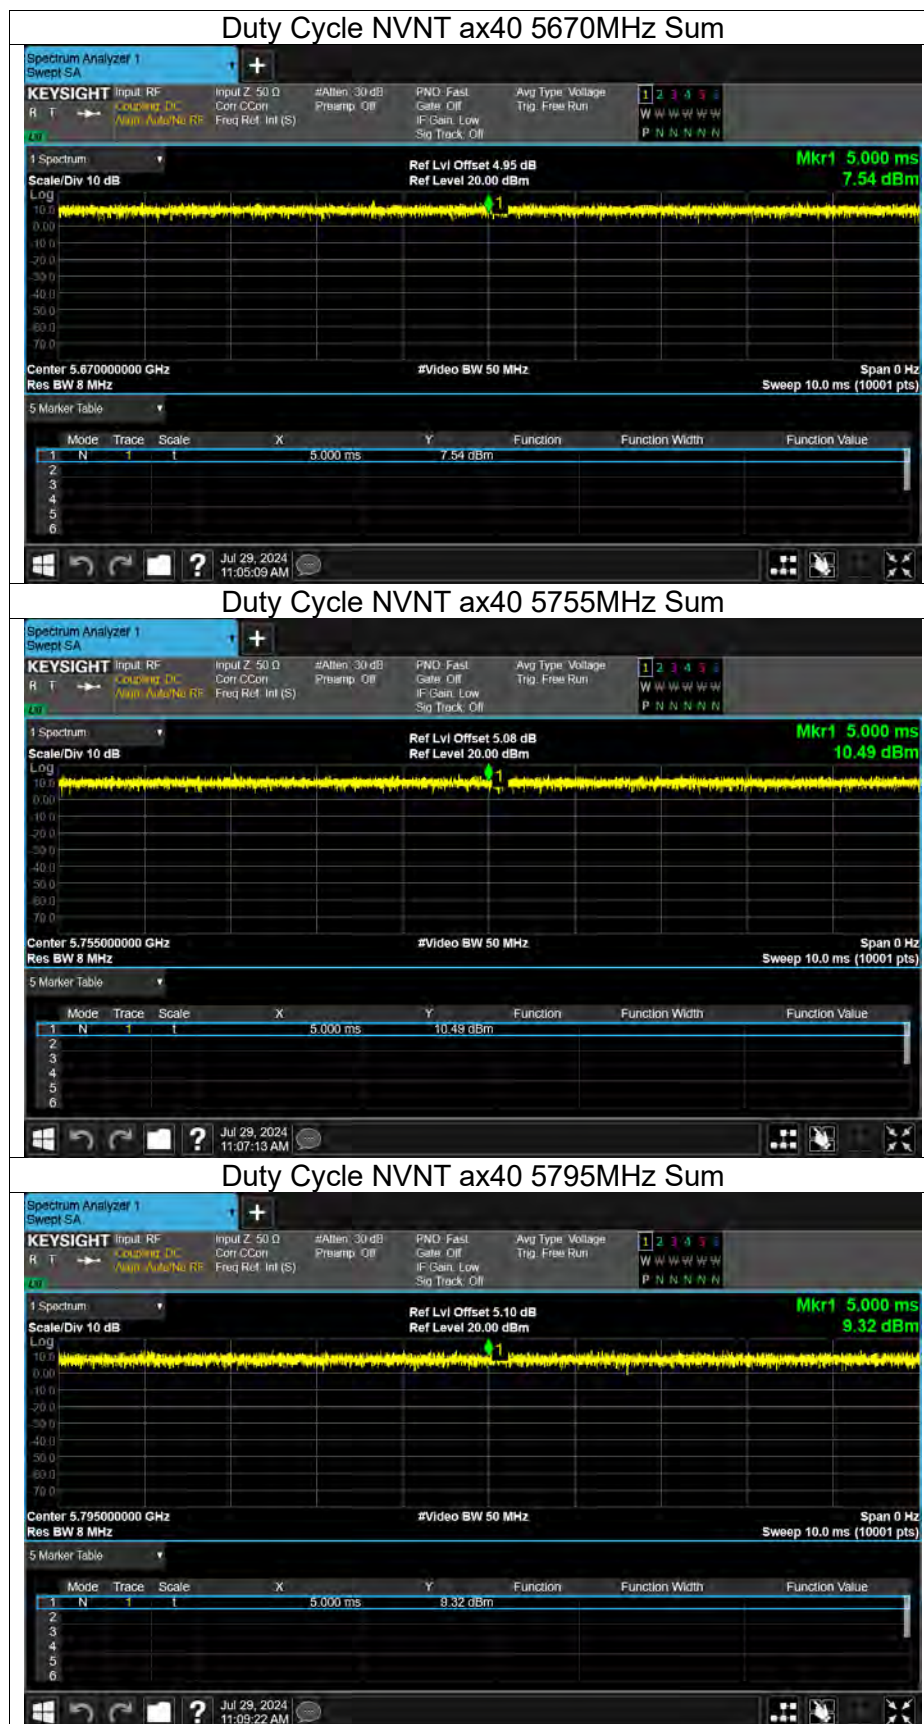


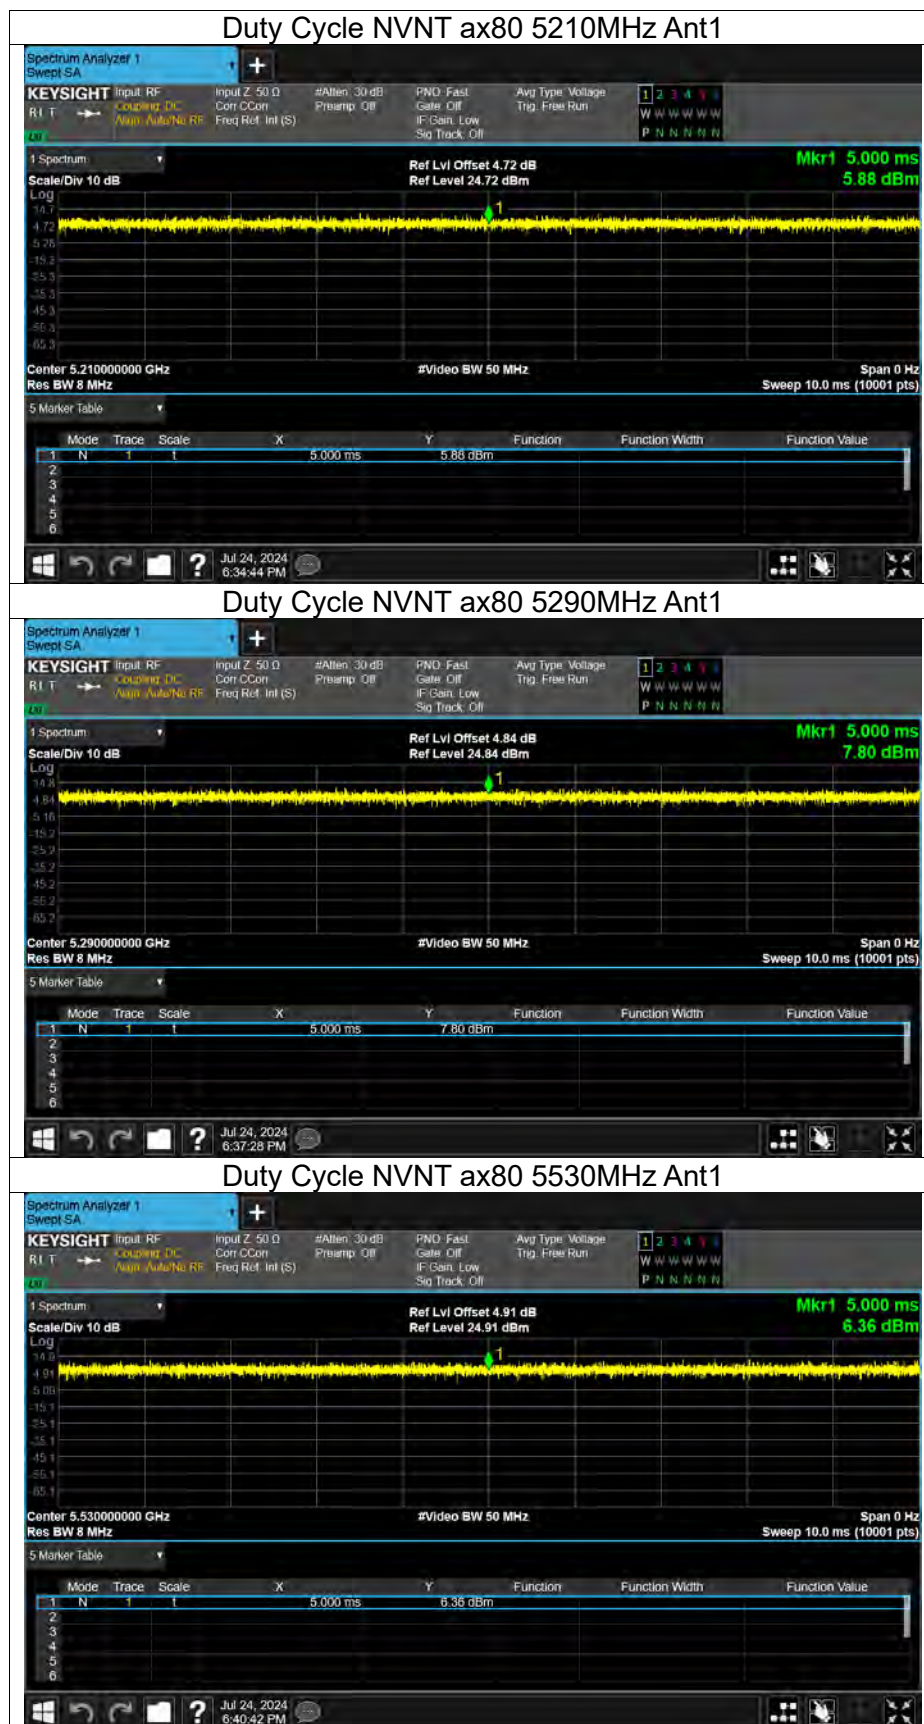

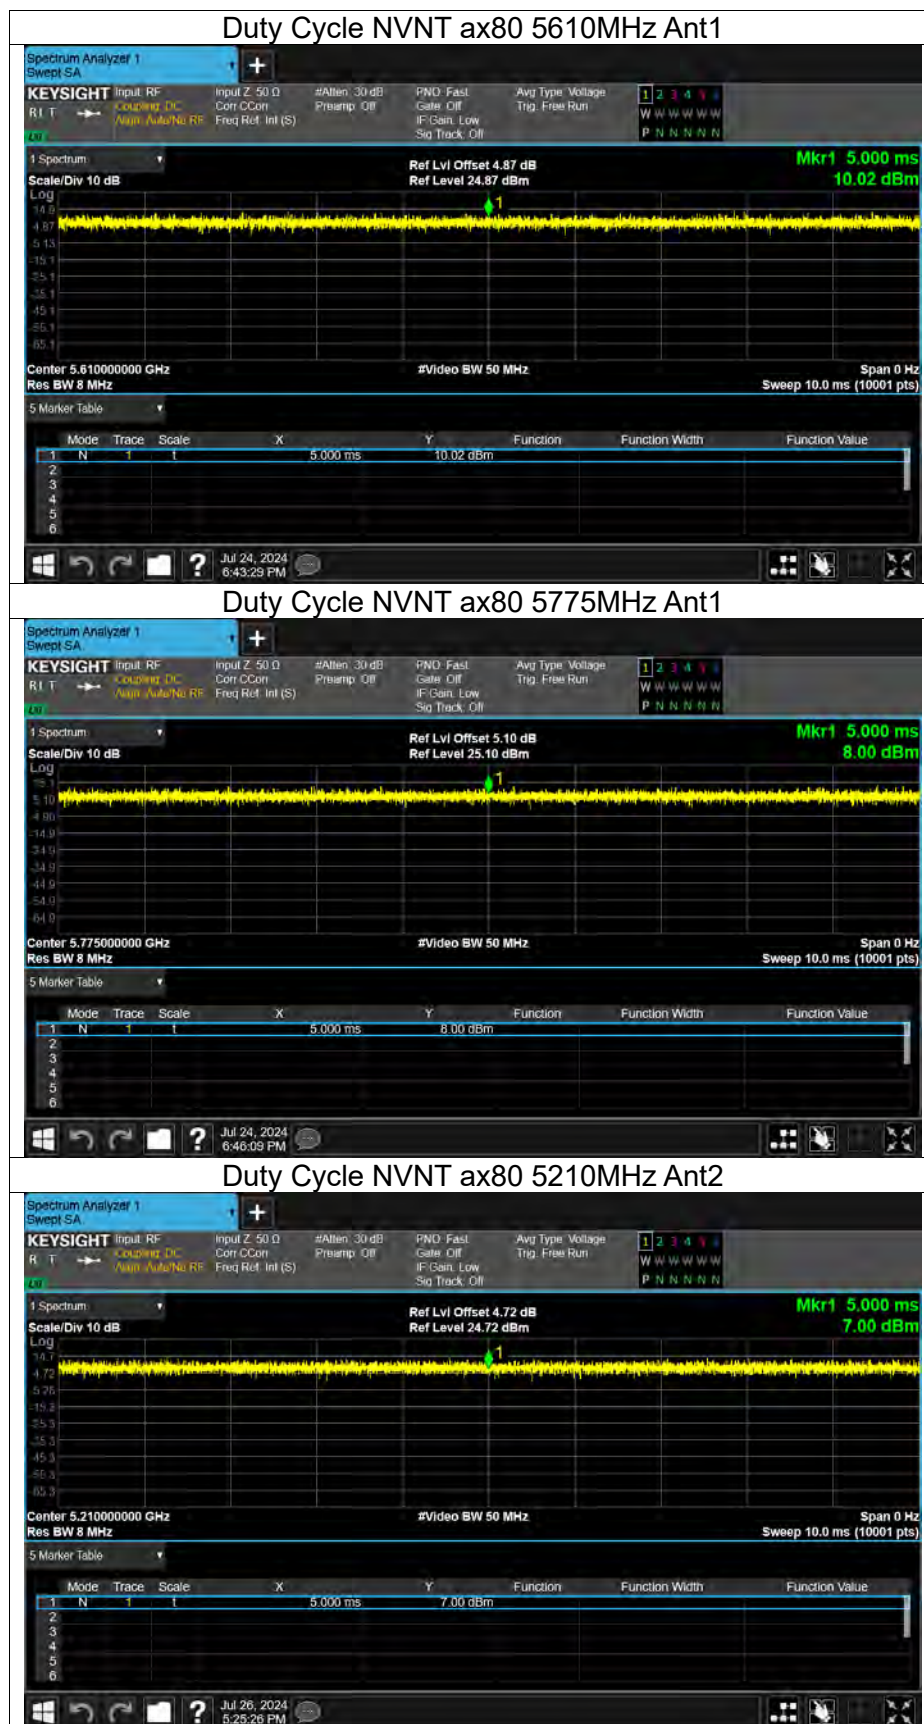

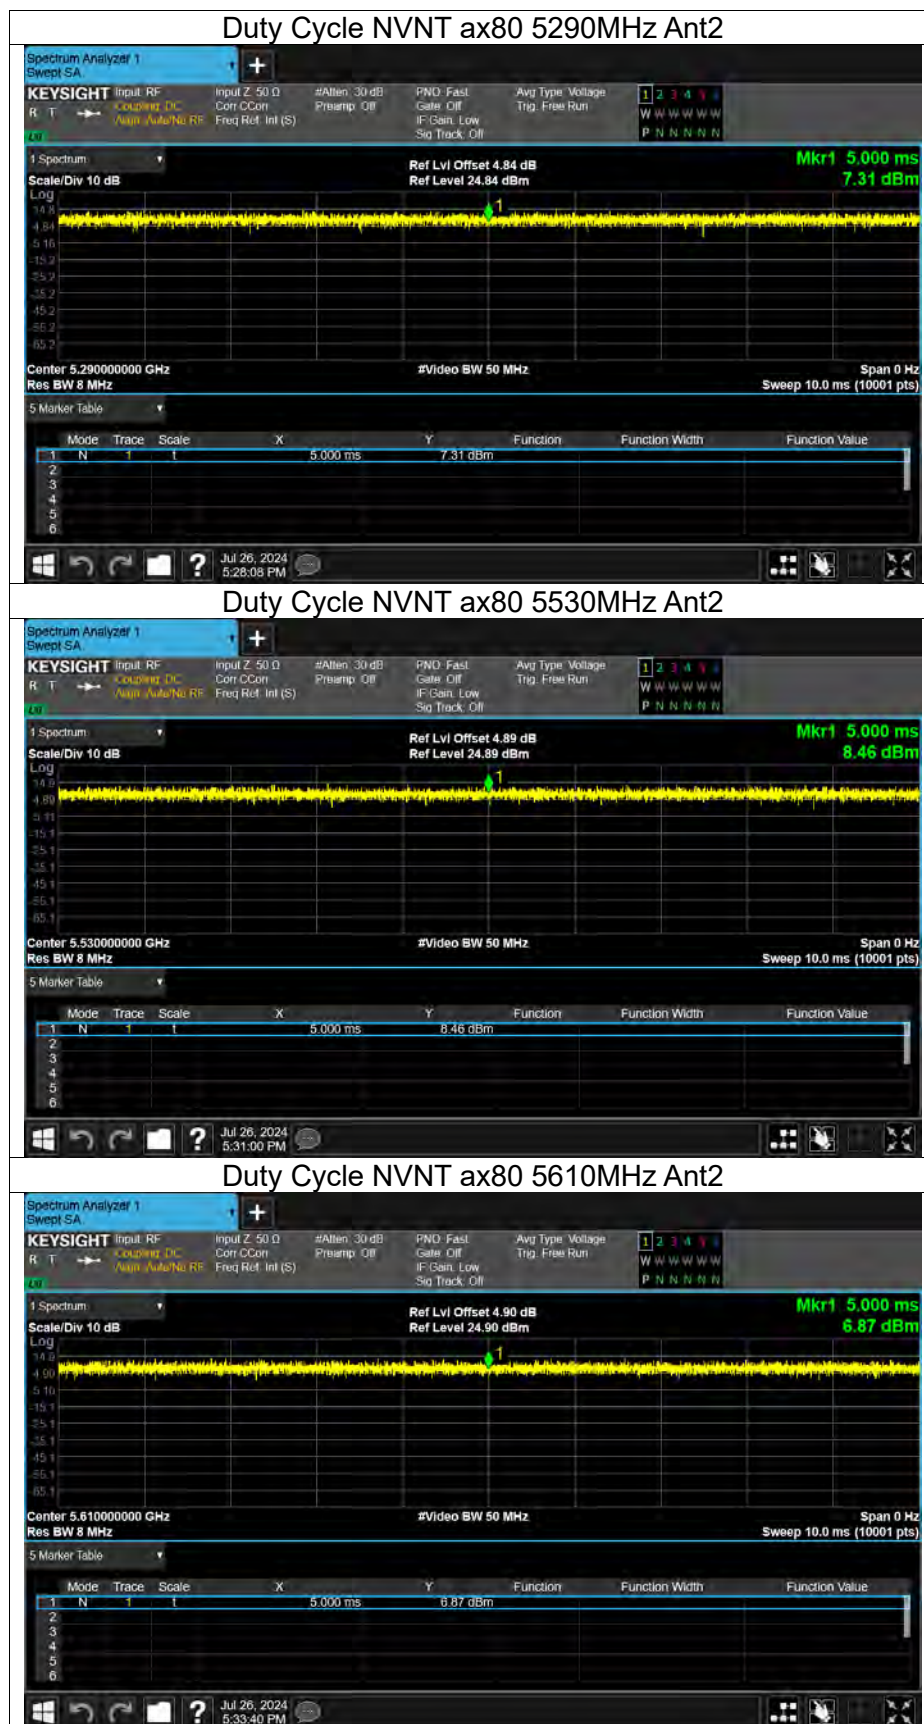

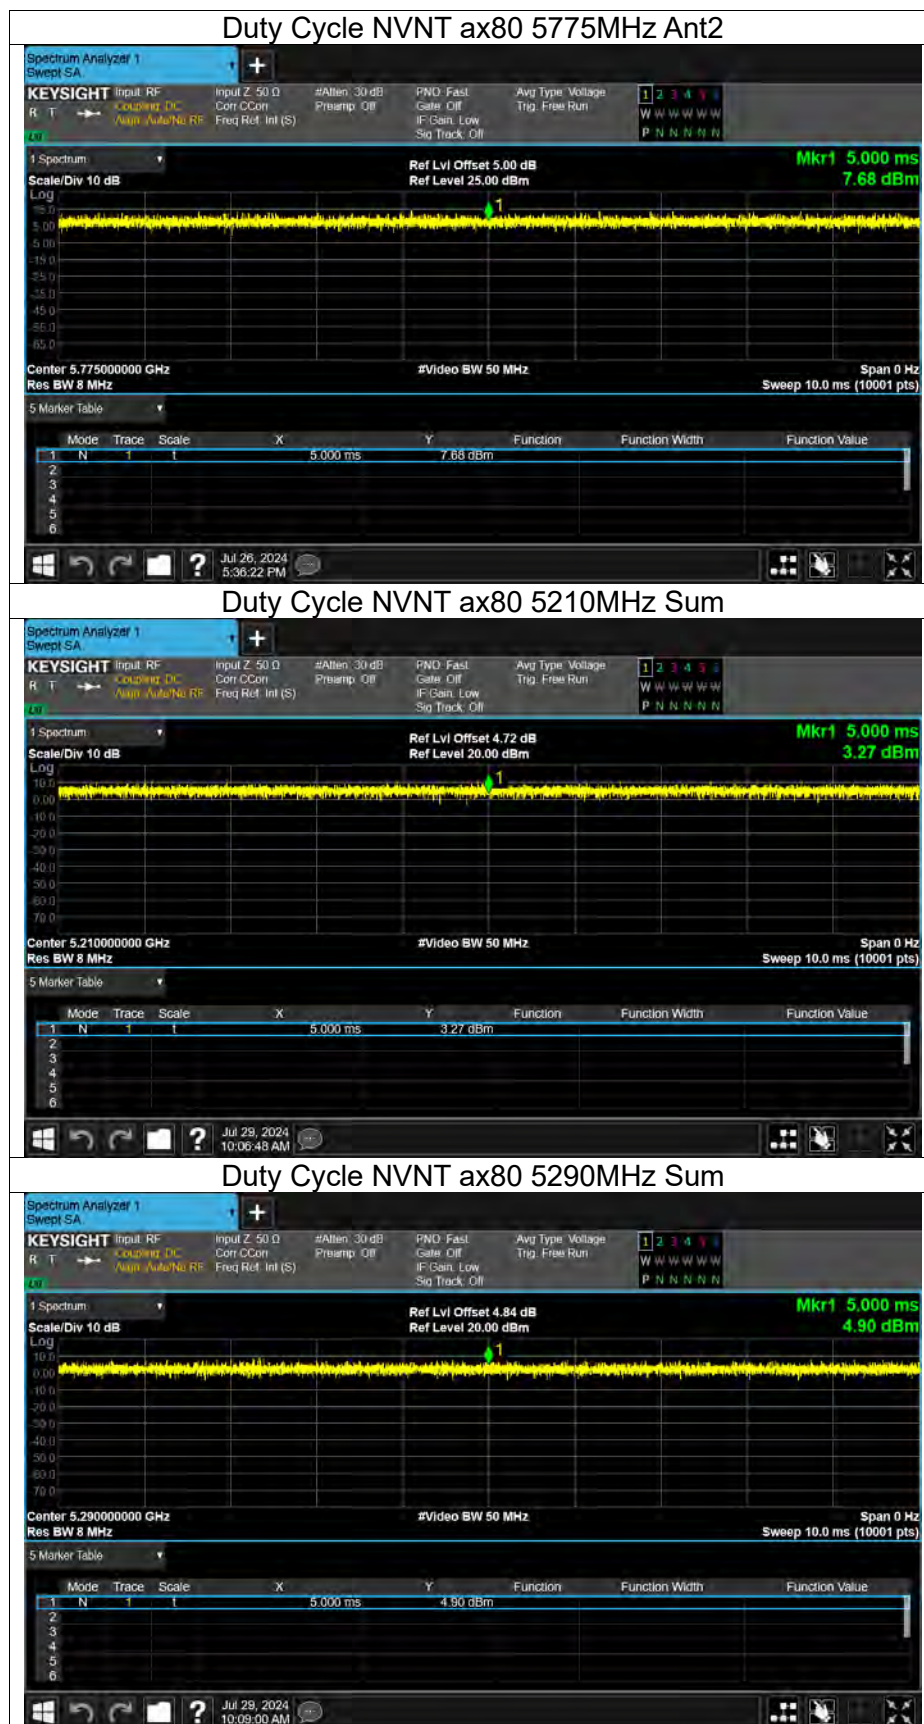

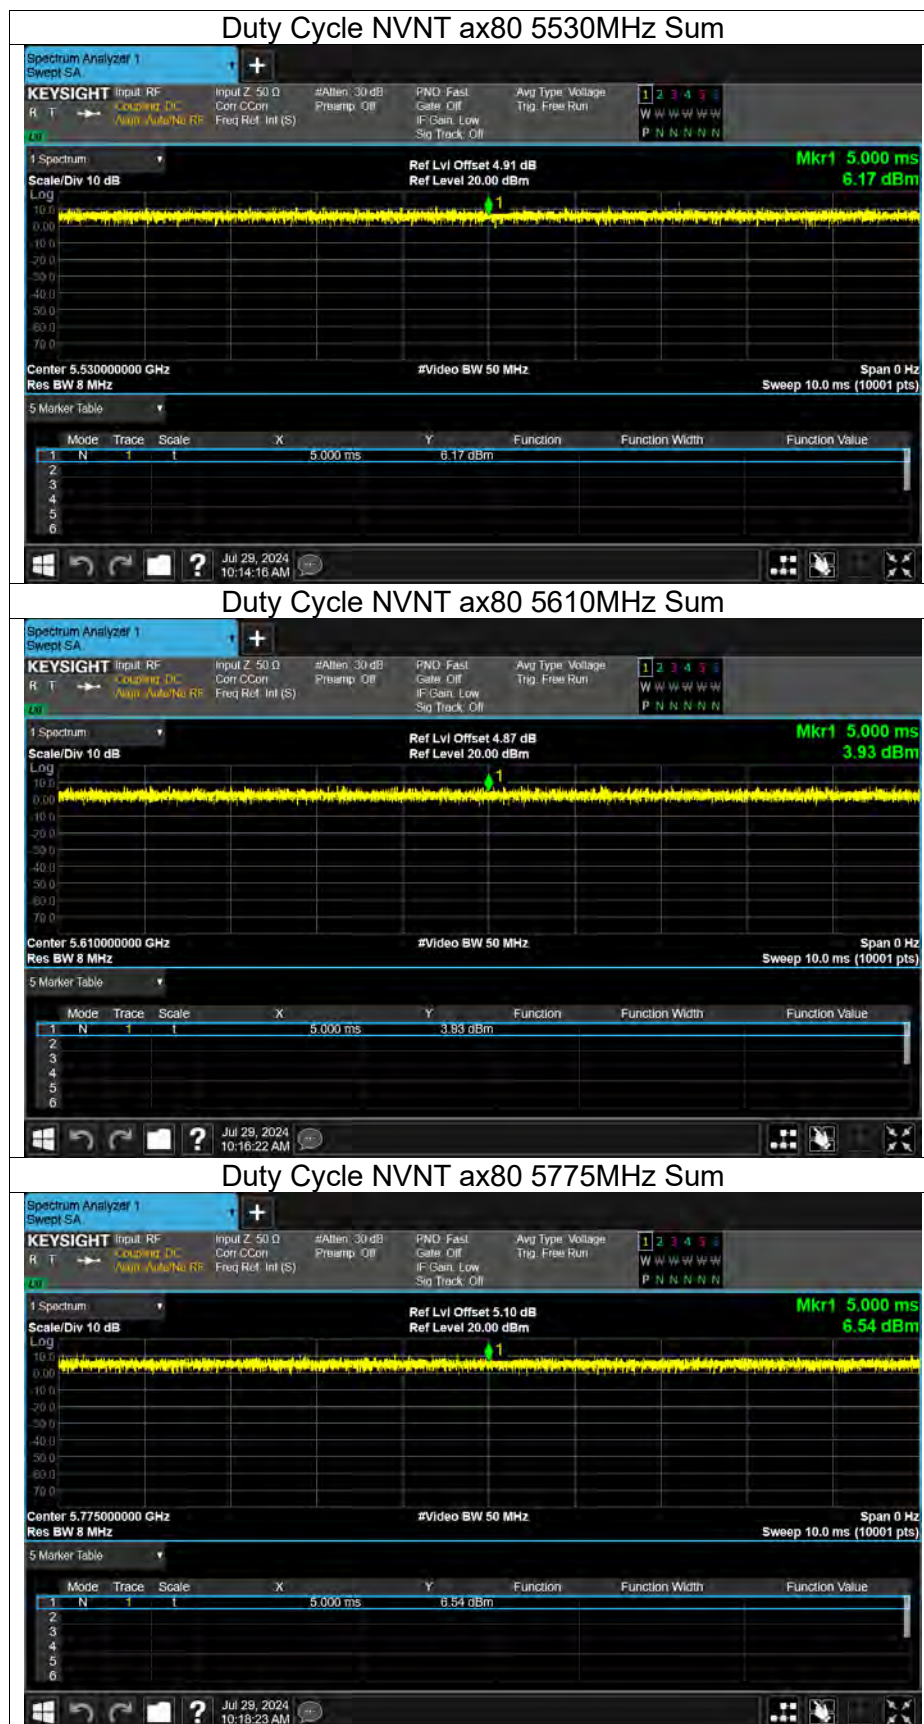



Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	15.01	0	15.01	24	Pass
NVNT	a	5200	Ant1	14.92	0	14.92	24	Pass
NVNT	a	5240	Ant1	15.25	0	15.25	24	Pass
NVNT	a	5260	Ant1	15.56	0	15.56	24	Pass
NVNT	a	5300	Ant1	14.99	0	14.99	24	Pass
NVNT	a	5320	Ant1	15.09	0	15.09	24	Pass
NVNT	a	5500	Ant1	15.3	0	15.3	24	Pass
NVNT	a	5580	Ant1	15.62	0	15.62	24	Pass
NVNT	a	5700	Ant1	16.04	0	16.04	24	Pass
NVNT	a	5745	Ant1	16.08	0	16.08	30	Pass
NVNT	a	5785	Ant1	15.46	0	15.46	30	Pass
NVNT	a	5825	Ant1	15.95	0	15.95	30	Pass
NVNT	a	5180	Ant2	17.58	0	17.58	24	Pass
NVNT	a	5200	Ant2	16.89	0	16.89	24	Pass
NVNT	a	5240	Ant2	16.97	0	16.97	24	Pass
NVNT	a	5260	Ant2	17.54	0	17.54	24	Pass
NVNT	a	5300	Ant2	16.89	0	16.89	24	Pass
NVNT	a	5320	Ant2	17.03	0	17.03	24	Pass
NVNT	a	5500	Ant2	16.1	0	16.1	24	Pass
NVNT	a	5580	Ant2	16.89	0	16.89	24	Pass
NVNT	a	5700	Ant2	16.64	0	16.64	24	Pass
NVNT	a	5745	Ant2	16.66	0	16.66	30	Pass
NVNT	a	5785	Ant2	16.84	0	16.84	30	Pass
NVNT	a	5825	Ant2	16.68	0	16.68	30	Pass
NVNT	n20	5180	Ant1	13.17	0	13.17	24	Pass
NVNT	n20	5200	Ant1	13.26	0	13.26	24	Pass
NVNT	n20	5240	Ant1	13.97	0	13.97	24	Pass
NVNT	n20	5260	Ant1	14.21	0	14.21	24	Pass
NVNT	n20	5300	Ant1	13.49	0	13.49	24	Pass
NVNT	n20	5320	Ant1	13.59	0	13.59	24	Pass
NVNT	n20	5500	Ant1	13.64	0	13.64	24	Pass
NVNT	n20	5580	Ant1	14.01	0	14.01	24	Pass
NVNT	n20	5700	Ant1	14.33	0	14.33	24	Pass
NVNT	n20	5745	Ant1	14.39	0	14.39	30	Pass
NVNT	n20	5785	Ant1	14.33	0	14.33	30	Pass
NVNT	n20	5825	Ant1	14.11	0	14.11	30	Pass
NVNT	n20	5180	Ant2	15.96	0	15.96	24	Pass
NVNT	n20	5200	Ant2	14.78	0	14.78	24	Pass
NVNT	n20	5240	Ant2	15.18	0	15.18	24	Pass
NVNT	n20	5260	Ant2	15.69	0	15.69	24	Pass
NVNT	n20	5300	Ant2	14.95	0	14.95	24	Pass
NVNT	n20	5320	Ant2	15.22	0	15.22	24	Pass
NVNT	n20	5500	Ant2	13.85	0	13.85	24	Pass
NVNT	n20	5580	Ant2	14.34	0	14.34	24	Pass
NVNT	n20	5700	Ant2	14.5	0	14.5	24	Pass
NVNT	n20	5745	Ant2	14.36	0	14.36	30	Pass
NVNT	n20	5785	Ant2	14.43	0	14.43	30	Pass
NVNT	n20	5825	Ant2	14.65	0	14.65	30	Pass
NVNT	n20	5180	Ant1	12.13	0	12.13	24	Pass
NVNT	n20	5180	Ant2	12.06	0	12.06	24	Pass
NVNT	n20	5180	Sum	15.11	0	15.11	24	Pass



NVNT	n20	5200	Ant1	12.18	0	12.18	24	Pass
NVNT	n20	5200	Ant2	11.88	0	11.88	24	Pass
NVNT	n20	5200	Sum	15.04	0	15.04	24	Pass
NVNT	n20	5240	Ant1	12.16	0	12.16	24	Pass
NVNT	n20	5240	Ant2	12.54	0	12.54	24	Pass
NVNT	n20	5240	Sum	15.36	0	15.36	24	Pass
NVNT	n20	5260	Ant1	12.01	0	12.01	24	Pass
NVNT	n20	5260	Ant2	10.59	0	10.59	24	Pass
NVNT	n20	5260	Sum	14.37	0	14.37	24	Pass
NVNT	n20	5300	Ant1	9.45	0	9.45	24	Pass
NVNT	n20	5300	Ant2	11.83	0	11.83	24	Pass
NVNT	n20	5300	Sum	13.81	0	13.81	24	Pass
NVNT	n20	5320	Ant1	12.96	0	12.96	24	Pass
NVNT	n20	5320	Ant2	12.16	0	12.16	24	Pass
NVNT	n20	5320	Sum	15.59	0	15.59	24	Pass
NVNT	n20	5500	Ant1	11.45	0	11.45	24	Pass
NVNT	n20	5500	Ant2	10.31	0	10.31	24	Pass
NVNT	n20	5500	Sum	13.93	0	13.93	24	Pass
NVNT	n20	5580	Ant1	12	0	12	24	Pass
NVNT	n20	5580	Ant2	11.45	0	11.45	24	Pass
NVNT	n20	5580	Sum	14.74	0	14.74	24	Pass
NVNT	n20	5700	Ant1	12.84	0	12.84	24	Pass
NVNT	n20	5700	Ant2	11.6	0	11.6	24	Pass
NVNT	n20	5700	Sum	15.27	0	15.27	24	Pass
NVNT	n20	5745	Ant1	10.84	0	10.84	30	Pass
NVNT	n20	5745	Ant2	11.65	0	11.65	30	Pass
NVNT	n20	5745	Sum	14.27	0	14.27	30	Pass
NVNT	n20	5785	Ant1	12.3	0	12.3	30	Pass
NVNT	n20	5785	Ant2	13.78	0	13.78	30	Pass
NVNT	n20	5785	Sum	16.11	0	16.11	30	Pass
NVNT	n20	5825	Ant1	11.32	0	11.32	30	Pass
NVNT	n20	5825	Ant2	11.67	0	11.67	30	Pass
NVNT	n20	5825	Sum	14.51	0	14.51	30	Pass
NVNT	n40	5190	Ant1	12.08	0	12.08	24	Pass
NVNT	n40	5230	Ant1	14.02	0	14.02	24	Pass
NVNT	n40	5270	Ant1	14.04	0	14.04	24	Pass
NVNT	n40	5310	Ant1	13.38	0	13.38	24	Pass
NVNT	n40	5510	Ant1	13.49	0	13.49	24	Pass
NVNT	n40	5550	Ant1	13.62	0	13.62	24	Pass
NVNT	n40	5670	Ant1	13.89	0	13.89	24	Pass
NVNT	n40	5755	Ant1	13.93	0	13.93	30	Pass
NVNT	n40	5795	Ant1	14.14	0	14.14	30	Pass
NVNT	n40	5190	Ant2	15.34	0	15.34	24	Pass
NVNT	n40	5230	Ant2	15.23	0	15.23	24	Pass
NVNT	n40	5270	Ant2	15.58	0	15.58	24	Pass
NVNT	n40	5310	Ant2	15.42	0	15.42	24	Pass
NVNT	n40	5510	Ant2	14.34	0	14.34	24	Pass
NVNT	n40	5550	Ant2	14.58	0	14.58	24	Pass
NVNT	n40	5670	Ant2	14.86	0	14.86	24	Pass
NVNT	n40	5755	Ant2	14.43	0	14.43	30	Pass
NVNT	n40	5795	Ant2	14.74	0	14.74	30	Pass
NVNT	n40	5190	Ant1	10.94	0	10.94	24	Pass
NVNT	n40	5190	Ant2	12.1	0	12.1	24	Pass
NVNT	n40	5190	Sum	14.57	0	14.57	24	Pass
NVNT	n40	5230	Ant1	12.02	0	12.02	24	Pass
NVNT	n40	5230	Ant2	13.47	0	13.47	24	Pass



NVNT	n40	5230	Sum	15.82	0	15.82	24	Pass
NVNT	n40	5270	Ant1	11.37	0	11.37	24	Pass
NVNT	n40	5270	Ant2	12.61	0	12.61	24	Pass
NVNT	n40	5270	Sum	15.04	0	15.04	24	Pass
NVNT	n40	5310	Ant1	11.42	0	11.42	24	Pass
NVNT	n40	5310	Ant2	12.04	0	12.04	24	Pass
NVNT	n40	5310	Sum	14.75	0	14.75	24	Pass
NVNT	n40	5510	Ant1	9.41	0	9.41	24	Pass
NVNT	n40	5510	Ant2	11.19	0	11.19	24	Pass
NVNT	n40	5510	Sum	13.4	0	13.4	24	Pass
NVNT	n40	5550	Ant1	13.38	0	13.38	24	Pass
NVNT	n40	5550	Ant2	11.7	0	11.7	24	Pass
NVNT	n40	5550	Sum	15.63	0	15.63	24	Pass
NVNT	n40	5670	Ant1	11.75	0	11.75	24	Pass
NVNT	n40	5670	Ant2	13.16	0	13.16	24	Pass
NVNT	n40	5670	Sum	15.52	0	15.52	24	Pass
NVNT	n40	5755	Ant1	11.55	0	11.55	30	Pass
NVNT	n40	5755	Ant2	11.41	0	11.41	30	Pass
NVNT	n40	5755	Sum	14.49	0	14.49	30	Pass
NVNT	n40	5795	Ant1	13.82	0	13.82	30	Pass
NVNT	n40	5795	Ant2	11.7	0	11.7	30	Pass
NVNT	n40	5795	Sum	15.9	0	15.9	30	Pass
NVNT	ac20	5180	Ant1	12.12	0	12.12	24	Pass
NVNT	ac20	5200	Ant1	12.05	0	12.05	24	Pass
NVNT	ac20	5240	Ant1	13.02	0	13.02	24	Pass
NVNT	ac20	5260	Ant1	13.26	0	13.26	24	Pass
NVNT	ac20	5300	Ant1	12.42	0	12.42	24	Pass
NVNT	ac20	5320	Ant1	12.17	0	12.17	24	Pass
NVNT	ac20	5500	Ant1	12.35	0	12.35	24	Pass
NVNT	ac20	5580	Ant1	12.82	0	12.82	24	Pass
NVNT	ac20	5700	Ant1	13.05	0	13.05	24	Pass
NVNT	ac20	5745	Ant1	13.18	0	13.18	30	Pass
NVNT	ac20	5785	Ant1	13.26	0	13.26	30	Pass
NVNT	ac20	5825	Ant1	13	0	13	30	Pass
NVNT	ac20	5180	Ant2	14.09	0	14.09	24	Pass
NVNT	ac20	5200	Ant2	14.04	0	14.04	24	Pass
NVNT	ac20	5240	Ant2	14.36	0	14.36	24	Pass
NVNT	ac20	5260	Ant2	14.94	0	14.94	24	Pass
NVNT	ac20	5300	Ant2	14.06	0	14.06	24	Pass
NVNT	ac20	5320	Ant2	13.99	0	13.99	24	Pass
NVNT	ac20	5500	Ant2	13.46	0	13.46	24	Pass
NVNT	ac20	5580	Ant2	13.85	0	13.85	24	Pass
NVNT	ac20	5700	Ant2	13.64	0	13.64	24	Pass
NVNT	ac20	5745	Ant2	13.61	0	13.61	30	Pass
NVNT	ac20	5785	Ant2	13.56	0	13.56	30	Pass
NVNT	ac20	5825	Ant2	13.38	0	13.38	30	Pass
NVNT	ac20	5180	Ant1	7.68	0	7.68	24	Pass
NVNT	ac20	5180	Ant2	11.86	0	11.86	24	Pass
NVNT	ac20	5180	Sum	13.26	0	13.26	24	Pass
NVNT	ac20	5200	Ant1	9.22	0	9.22	24	Pass
NVNT	ac20	5200	Ant2	11.67	0	11.67	24	Pass
NVNT	ac20	5200	Sum	13.63	0	13.63	24	Pass
NVNT	ac20	5240	Ant1	9.69	0	9.69	24	Pass
NVNT	ac20	5240	Ant2	10.33	0	10.33	24	Pass
NVNT	ac20	5240	Sum	13.03	0	13.03	24	Pass
NVNT	ac20	5260	Ant1	8.38	0	8.38	24	Pass



NVNT	ac20	5260	Ant2	12.76	0	12.76	24	Pass
NVNT	ac20	5260	Sum	14.11	0	14.11	24	Pass
NVNT	ac20	5300	Ant1	8.92	0	8.92	24	Pass
NVNT	ac20	5300	Ant2	11.5	0	11.5	24	Pass
NVNT	ac20	5300	Sum	13.41	0	13.41	24	Pass
NVNT	ac20	5320	Ant1	9.33	0	9.33	24	Pass
NVNT	ac20	5320	Ant2	11.51	0	11.51	24	Pass
NVNT	ac20	5320	Sum	13.57	0	13.57	24	Pass
NVNT	ac20	5500	Ant1	8.8	0	8.8	24	Pass
NVNT	ac20	5500	Ant2	11.24	0	11.24	24	Pass
NVNT	ac20	5500	Sum	13.2	0	13.2	24	Pass
NVNT	ac20	5580	Ant1	10.16	0	10.16	24	Pass
NVNT	ac20	5580	Ant2	11.77	0	11.77	24	Pass
NVNT	ac20	5580	Sum	14.05	0	14.05	24	Pass
NVNT	ac20	5700	Ant1	8.9	0	8.9	24	Pass
NVNT	ac20	5700	Ant2	11.18	0	11.18	24	Pass
NVNT	ac20	5700	Sum	13.2	0	13.2	24	Pass
NVNT	ac20	5745	Ant1	9.75	0	9.75	30	Pass
NVNT	ac20	5745	Ant2	11.08	0	11.08	30	Pass
NVNT	ac20	5745	Sum	13.48	0	13.48	30	Pass
NVNT	ac20	5785	Ant1	11.28	0	11.28	30	Pass
NVNT	ac20	5785	Ant2	11.71	0	11.71	30	Pass
NVNT	ac20	5785	Sum	14.51	0	14.51	30	Pass
NVNT	ac20	5825	Ant1	9.28	0	9.28	30	Pass
NVNT	ac20	5825	Ant2	11.17	0	11.17	30	Pass
NVNT	ac20	5825	Sum	13.34	0	13.34	30	Pass
NVNT	ac40	5190	Ant1	12.45	0	12.45	24	Pass
NVNT	ac40	5230	Ant1	12.92	0	12.92	24	Pass
NVNT	ac40	5270	Ant1	13.28	0	13.28	24	Pass
NVNT	ac40	5310	Ant1	12.34	0	12.34	24	Pass
NVNT	ac40	5510	Ant1	12.34	0	12.34	24	Pass
NVNT	ac40	5550	Ant1	12.55	0	12.55	24	Pass
NVNT	ac40	5670	Ant1	13	0	13	24	Pass
NVNT	ac40	5755	Ant1	12.98	0	12.98	30	Pass
NVNT	ac40	5795	Ant1	13	0	13	30	Pass
NVNT	ac40	5190	Ant2	14.37	0	14.37	24	Pass
NVNT	ac40	5230	Ant2	14.37	0	14.37	24	Pass
NVNT	ac40	5270	Ant2	14.52	0	14.52	24	Pass
NVNT	ac40	5310	Ant2	14.14	0	14.14	24	Pass
NVNT	ac40	5510	Ant2	13.23	0	13.23	24	Pass
NVNT	ac40	5550	Ant2	13.25	0	13.25	24	Pass
NVNT	ac40	5670	Ant2	13.46	0	13.46	24	Pass
NVNT	ac40	5755	Ant2	13.63	0	13.63	30	Pass
NVNT	ac40	5795	Ant2	13.53	0	13.53	30	Pass
NVNT	ac40	5190	Ant1	8.78	0	8.78	24	Pass
NVNT	ac40	5190	Ant2	11.97	0	11.97	24	Pass
NVNT	ac40	5190	Sum	13.67	0	13.67	24	Pass
NVNT	ac40	5230	Ant1	12	0	12	24	Pass
NVNT	ac40	5230	Ant2	12.12	0	12.12	24	Pass
NVNT	ac40	5230	Sum	15.07	0	15.07	24	Pass
NVNT	ac40	5270	Ant1	8.06	0	8.06	24	Pass
NVNT	ac40	5270	Ant2	12.06	0	12.06	24	Pass
NVNT	ac40	5270	Sum	13.52	0	13.52	24	Pass
NVNT	ac40	5310	Ant1	9.23	0	9.23	24	Pass
NVNT	ac40	5310	Ant2	11.62	0	11.62	24	Pass
NVNT	ac40	5310	Sum	13.6	0	13.6	24	Pass



NVNT	ac40	5510	Ant1	9.24	0	9.24	24	Pass
NVNT	ac40	5510	Ant2	10.59	0	10.59	24	Pass
NVNT	ac40	5510	Sum	12.98	0	12.98	24	Pass
NVNT	ac40	5550	Ant1	9.92	0	9.92	24	Pass
NVNT	ac40	5550	Ant2	11.36	0	11.36	24	Pass
NVNT	ac40	5550	Sum	13.71	0	13.71	24	Pass
NVNT	ac40	5670	Ant1	10.12	0	10.12	24	Pass
NVNT	ac40	5670	Ant2	10.77	0	10.77	24	Pass
NVNT	ac40	5670	Sum	13.47	0	13.47	24	Pass
NVNT	ac40	5755	Ant1	9.63	0	9.63	30	Pass
NVNT	ac40	5755	Ant2	12.94	0	12.94	30	Pass
NVNT	ac40	5755	Sum	14.6	0	14.6	30	Pass
NVNT	ac40	5795	Ant1	10.22	0	10.22	30	Pass
NVNT	ac40	5795	Ant2	9.83	0	9.83	30	Pass
NVNT	ac40	5795	Sum	13.04	0	13.04	30	Pass
NVNT	ac80	5210	Ant1	12.07	0	12.07	24	Pass
NVNT	ac80	5290	Ant1	12.35	0	12.35	24	Pass
NVNT	ac80	5530	Ant1	12.12	0	12.12	24	Pass
NVNT	ac80	5610	Ant1	12.9	0	12.9	24	Pass
NVNT	ac80	5775	Ant1	13.18	0	13.18	30	Pass
NVNT	ac80	5210	Ant2	13.39	0	13.39	24	Pass
NVNT	ac80	5290	Ant2	14.12	0	14.12	24	Pass
NVNT	ac80	5530	Ant2	12.89	0	12.89	24	Pass
NVNT	ac80	5610	Ant2	13.29	0	13.29	24	Pass
NVNT	ac80	5775	Ant2	13.15	0	13.15	30	Pass
NVNT	ac80	5210	Ant1	8.78	0	8.78	24	Pass
NVNT	ac80	5210	Ant2	10.97	0	10.97	24	Pass
NVNT	ac80	5210	Sum	13.02	0	13.02	24	Pass
NVNT	ac80	5290	Ant1	8.21	0	8.21	24	Pass
NVNT	ac80	5290	Ant2	11.38	0	11.38	24	Pass
NVNT	ac80	5290	Sum	13.09	0	13.09	24	Pass
NVNT	ac80	5530	Ant1	10.21	0	10.21	24	Pass
NVNT	ac80	5530	Ant2	10.22	0	10.22	24	Pass
NVNT	ac80	5530	Sum	13.23	0	13.23	24	Pass
NVNT	ac80	5610	Ant1	8.95	0	8.95	24	Pass
NVNT	ac80	5610	Ant2	10.75	0	10.75	24	Pass
NVNT	ac80	5610	Sum	12.95	0	12.95	24	Pass
NVNT	ac80	5775	Ant1	10.61	0	10.61	30	Pass
NVNT	ac80	5775	Ant2	10.92	0	10.92	30	Pass
NVNT	ac80	5775	Sum	13.78	0	13.78	30	Pass
NVNT	ax20	5180	Ant1	11.42	0	11.42	24	Pass
NVNT	ax20	5200	Ant1	11.23	0	11.23	24	Pass
NVNT	ax20	5240	Ant1	11.65	0	11.65	24	Pass
NVNT	ax20	5260	Ant1	12.24	0	12.24	24	Pass
NVNT	ax20	5300	Ant1	11.34	0	11.34	24	Pass
NVNT	ax20	5320	Ant1	11.65	0	11.65	24	Pass
NVNT	ax20	5500	Ant1	11.66	0	11.66	24	Pass
NVNT	ax20	5580	Ant1	12.01	0	12.01	24	Pass
NVNT	ax20	5700	Ant1	12.12	0	12.12	24	Pass
NVNT	ax20	5745	Ant1	12.42	0	12.42	30	Pass
NVNT	ax20	5785	Ant1	12.45	0	12.45	30	Pass
NVNT	ax20	5825	Ant1	11.88	0	11.88	30	Pass
NVNT	ax20	5180	Ant2	12.81	0	12.81	24	Pass
NVNT	ax20	5200	Ant2	13.2	0	13.2	24	Pass
NVNT	ax20	5240	Ant2	13.4	0	13.4	24	Pass
NVNT	ax20	5260	Ant2	13.78	0	13.78	24	Pass



NVNT	ax20	5300	Ant2	13.12	0	13.12	24	Pass
NVNT	ax20	5320	Ant2	13.28	0	13.28	24	Pass
NVNT	ax20	5500	Ant2	12.33	0	12.33	24	Pass
NVNT	ax20	5580	Ant2	12.88	0	12.88	24	Pass
NVNT	ax20	5700	Ant2	12.73	0	12.73	24	Pass
NVNT	ax20	5745	Ant2	12.33	0	12.33	30	Pass
NVNT	ax20	5785	Ant2	12.79	0	12.79	30	Pass
NVNT	ax20	5825	Ant2	12.76	0	12.76	30	Pass
NVNT	ax20	5180	Ant1	6.72	0	6.72	24	Pass
NVNT	ax20	5180	Ant2	10.22	0	10.22	24	Pass
NVNT	ax20	5180	Sum	11.82	0	11.82	24	Pass
NVNT	ax20	5200	Ant1	8.36	0	8.36	24	Pass
NVNT	ax20	5200	Ant2	10.87	0	10.87	24	Pass
NVNT	ax20	5200	Sum	12.8	0	12.8	24	Pass
NVNT	ax20	5240	Ant1	9.96	0	9.96	24	Pass
NVNT	ax20	5240	Ant2	11.19	0	11.19	24	Pass
NVNT	ax20	5240	Sum	13.63	0	13.63	24	Pass
NVNT	ax20	5260	Ant1	11.19	0	11.19	24	Pass
NVNT	ax20	5260	Ant2	11.65	0	11.65	24	Pass
NVNT	ax20	5260	Sum	14.44	0	14.44	24	Pass
NVNT	ax20	5300	Ant1	7.93	0	7.93	24	Pass
NVNT	ax20	5300	Ant2	10.77	0	10.77	24	Pass
NVNT	ax20	5300	Sum	12.59	0	12.59	24	Pass
NVNT	ax20	5320	Ant1	11.08	0	11.08	24	Pass
NVNT	ax20	5320	Ant2	10.77	0	10.77	24	Pass
NVNT	ax20	5320	Sum	13.94	0	13.94	24	Pass
NVNT	ax20	5500	Ant1	8.01	0	8.01	24	Pass
NVNT	ax20	5500	Ant2	9.85	0	9.85	24	Pass
NVNT	ax20	5500	Sum	12.04	0	12.04	24	Pass
NVNT	ax20	5580	Ant1	12.31	0	12.31	24	Pass
NVNT	ax20	5580	Ant2	10.43	0	10.43	24	Pass
NVNT	ax20	5580	Sum	14.48	0	14.48	24	Pass
NVNT	ax20	5700	Ant1	11.92	0	11.92	24	Pass
NVNT	ax20	5700	Ant2	10.51	0	10.51	24	Pass
NVNT	ax20	5700	Sum	14.28	0	14.28	24	Pass
NVNT	ax20	5745	Ant1	8.89	0	8.89	30	Pass
NVNT	ax20	5745	Ant2	10.02	0	10.02	30	Pass
NVNT	ax20	5745	Sum	12.5	0	12.5	30	Pass
NVNT	ax20	5785	Ant1	12.7	0	12.7	30	Pass
NVNT	ax20	5785	Ant2	10.62	0	10.62	30	Pass
NVNT	ax20	5785	Sum	14.79	0	14.79	30	Pass
NVNT	ax20	5825	Ant1	9.87	0	9.87	30	Pass
NVNT	ax20	5825	Ant2	10.6	0	10.6	30	Pass
NVNT	ax20	5825	Sum	13.26	0	13.26	30	Pass
NVNT	ax40	5190	Ant1	11.74	0	11.74	24	Pass
NVNT	ax40	5230	Ant1	11.97	0	11.97	24	Pass
NVNT	ax40	5270	Ant1	12.03	0	12.03	24	Pass
NVNT	ax40	5310	Ant1	11.5	0	11.5	24	Pass
NVNT	ax40	5510	Ant1	11.52	0	11.52	24	Pass
NVNT	ax40	5550	Ant1	11.57	0	11.57	24	Pass
NVNT	ax40	5670	Ant1	12.21	0	12.21	24	Pass
NVNT	ax40	5755	Ant1	12.18	0	12.18	30	Pass
NVNT	ax40	5795	Ant1	12.28	0	12.28	30	Pass
NVNT	ax40	5190	Ant2	13.64	0	13.64	24	Pass
NVNT	ax40	5230	Ant2	13.47	0	13.47	24	Pass
NVNT	ax40	5270	Ant2	14.02	0	14.02	24	Pass







NVNT	ax40	5310	Ant2	13.49	0	13.49	24	Pass
NVNT	ax40	5510	Ant2	12.58	0	12.58	24	Pass
NVNT	ax40	5550	Ant2	12.58	0	12.58	24	Pass
NVNT	ax40	5670	Ant2	12.75	0	12.75	24	Pass
NVNT	ax40	5755	Ant2	12.51	0	12.51	30	Pass
NVNT	ax40	5795	Ant2	12.64	0	12.64	30	Pass
NVNT	ax40	5190	Ant1	7.54	0	7.54	24	Pass
NVNT	ax40	5190	Ant2	10.74	0	10.74	24	Pass
NVNT	ax40	5190	Sum	12.44	0	12.44	24	Pass
NVNT	ax40	5230	Ant1	9.92	0	9.92	24	Pass
NVNT	ax40	5230	Ant2	11.27	0	11.27	24	Pass
NVNT	ax40	5230	Sum	13.66	0	13.66	24	Pass
NVNT	ax40	5270	Ant1	8.41	0	8.41	24	Pass
NVNT	ax40	5270	Ant2	12.34	0	12.34	24	Pass
NVNT	ax40	5270	Sum	13.82	0	13.82	24	Pass
NVNT	ax40	5310	Ant1	9.44	0	9.44	24	Pass
NVNT	ax40	5310	Ant2	11.81	0	11.81	24	Pass
NVNT	ax40	5310	Sum	13.8	0	13.8	24	Pass
NVNT	ax40	5510	Ant1	9.42	0	9.42	24	Pass
NVNT	ax40	5510	Ant2	12.11	0	12.11	24	Pass
NVNT	ax40	5510	Sum	13.98	0	13.98	24	Pass
NVNT	ax40	5550	Ant1	9.13	0	9.13	24	Pass
NVNT	ax40	5550	Ant2	10.47	0	10.47	24	Pass
NVNT	ax40	5550	Sum	12.86	0	12.86	24	Pass
NVNT	ax40	5670	Ant1	10.19	0	10.19	24	Pass
NVNT	ax40	5670	Ant2	10.71	0	10.71	24	Pass
NVNT	ax40	5670	Sum	13.47	0	13.47	24	Pass
NVNT	ax40	5755	Ant1	10.46	0	10.46	30	Pass
NVNT	ax40	5755	Ant2	10.29	0	10.29	30	Pass
NVNT	ax40	5755	Sum	13.39	0	13.39	30	Pass
NVNT	ax40	5795	Ant1	9.08	0	9.08	30	Pass
NVNT	ax40	5795	Ant2	10.54	0	10.54	30	Pass
NVNT	ax40	5795	Sum	12.88	0	12.88	30	Pass
NVNT	ax80	5210	Ant1	11.44	0	11.44	24	Pass
NVNT	ax80	5290	Ant1	11.49	0	11.49	24	Pass
NVNT	ax80	5530	Ant1	11.35	0	11.35	24	Pass
NVNT	ax80	5610	Ant1	11.84	0	11.84	24	Pass
NVNT	ax80	5775	Ant1	12.42	0	12.42	30	Pass
NVNT	ax80	5210	Ant2	12.85	0	12.85	24	Pass
NVNT	ax80	5290	Ant2	13.33	0	13.33	24	Pass
NVNT	ax80	5530	Ant2	12.12	0	12.12	24	Pass
NVNT	ax80	5610	Ant2	12.38	0	12.38	24	Pass
NVNT	ax80	5775	Ant2	12.57	0	12.57	30	Pass
NVNT	ax80	5210	Ant1	9.13	0	9.13	24	Pass
NVNT	ax80	5210	Ant2	10.7	0	10.7	24	Pass
NVNT	ax80	5210	Sum	13	0	13	24	Pass
NVNT	ax80	5290	Ant1	7.42	0	7.42	24	Pass
NVNT	ax80	5290	Ant2	10.92	0	10.92	24	Pass
NVNT	ax80	5290	Sum	12.52	0	12.52	24	Pass
NVNT	ax80	5530	Ant1	9.79	0	9.79	24	Pass
NVNT	ax80	5530	Ant2	9.91	0	9.91	24	Pass
NVNT	ax80	5530	Sum	12.86	0	12.86	24	Pass
NVNT	ax80	5610	Ant1	7.98	0	7.98	24	Pass
NVNT	ax80	5610	Ant2	9.86	0	9.86	24	Pass
NVNT	ax80	5610	Sum	12.03	0	12.03	24	Pass
NVNT	ax80	5775	Ant1	9.9	0	9.9	30	Pass









NVNT	ax80	5775	Ant2	10.3	0	10.3	30	Pass
NVNT	ax80	5775	Sum	13.11	0	13.11	30	Pass








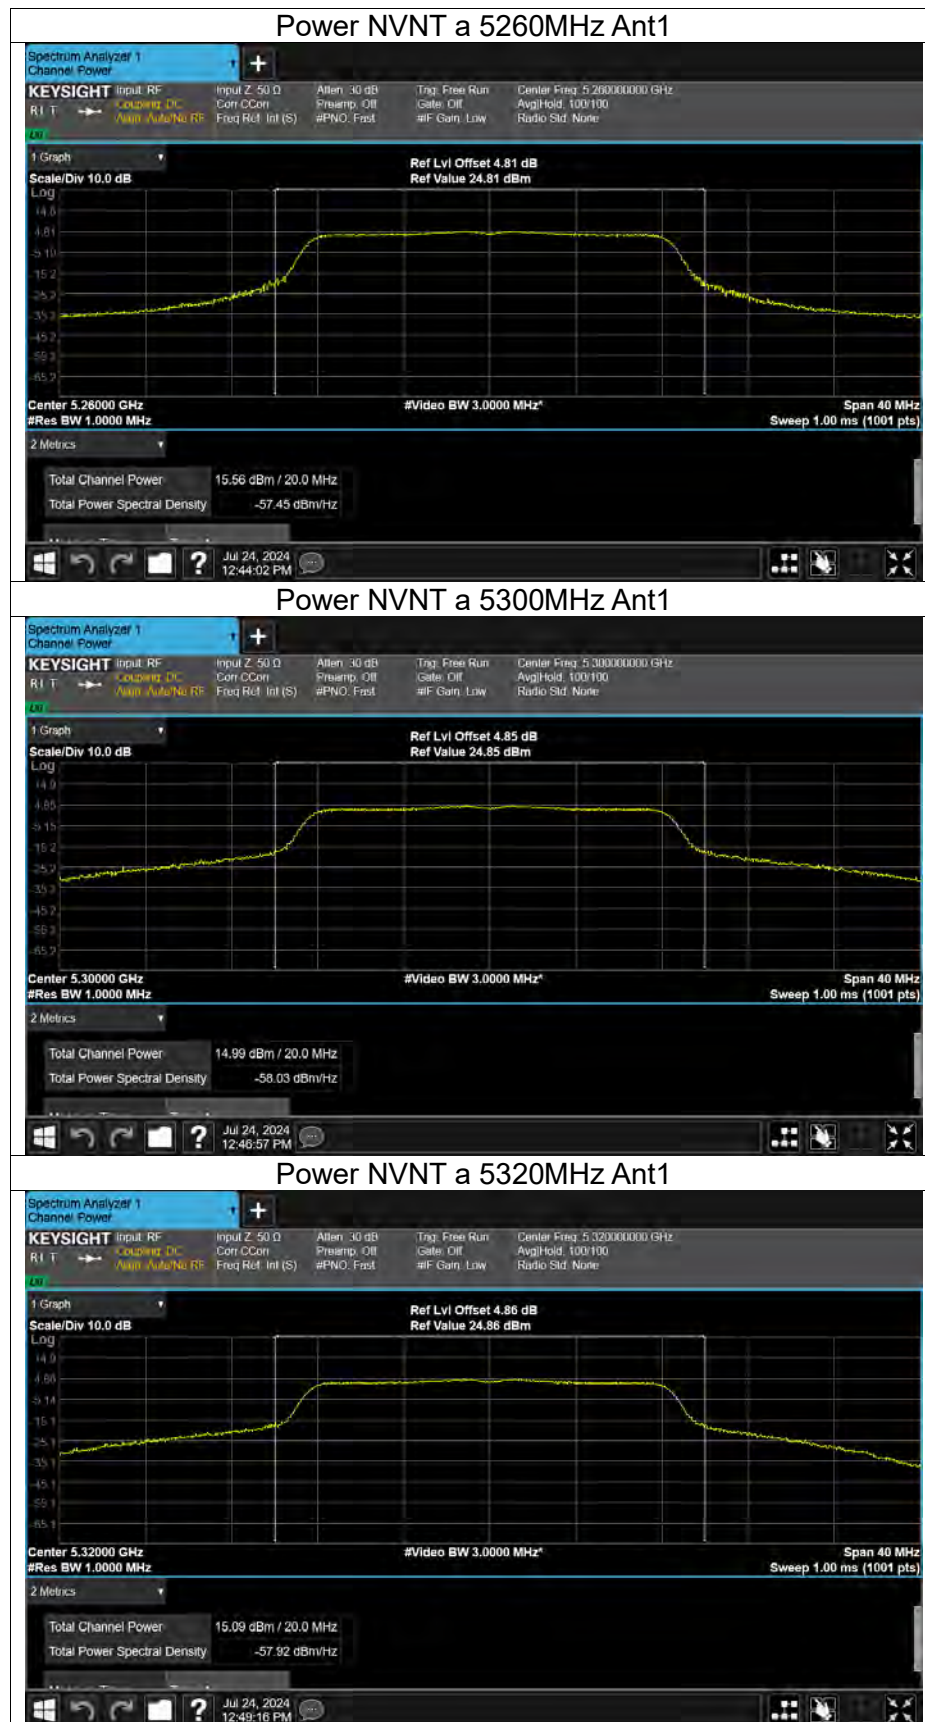


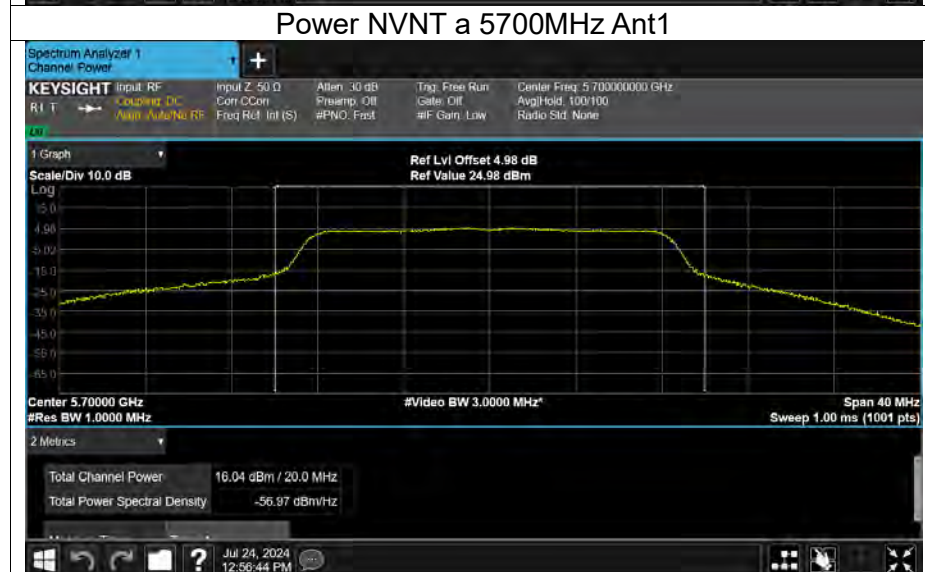
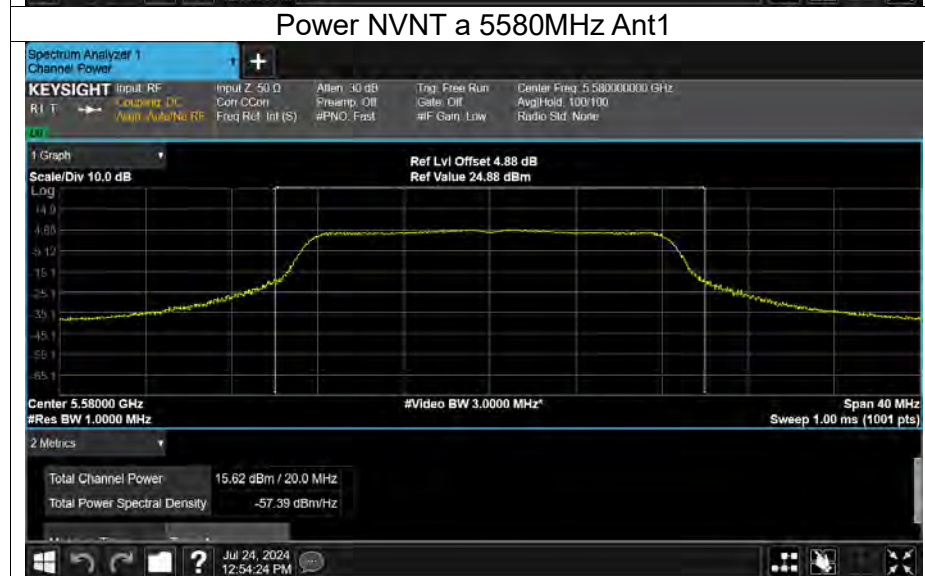
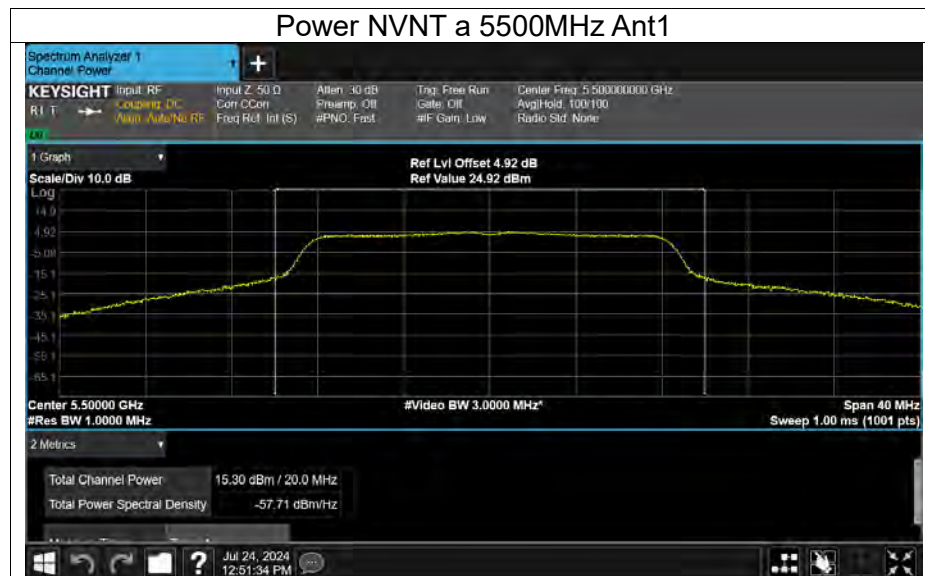


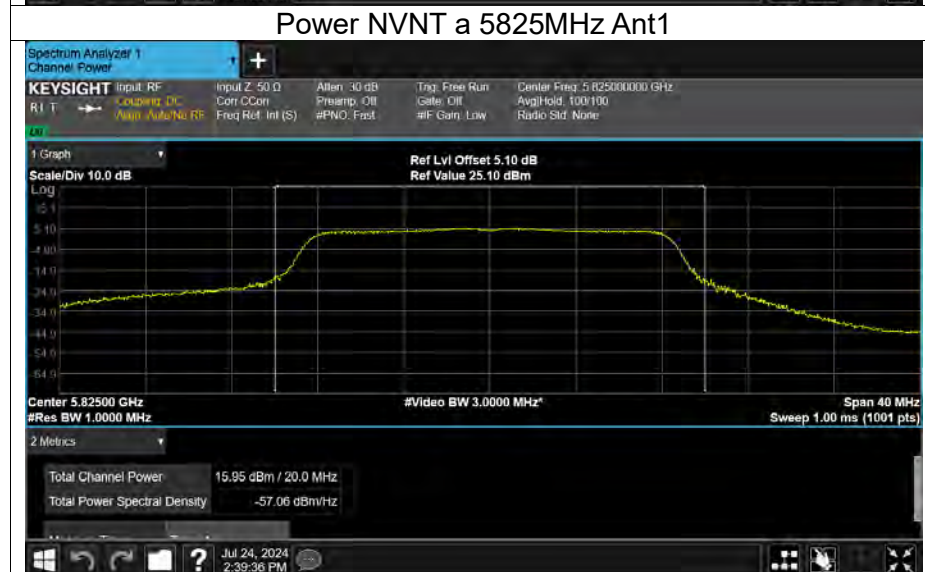
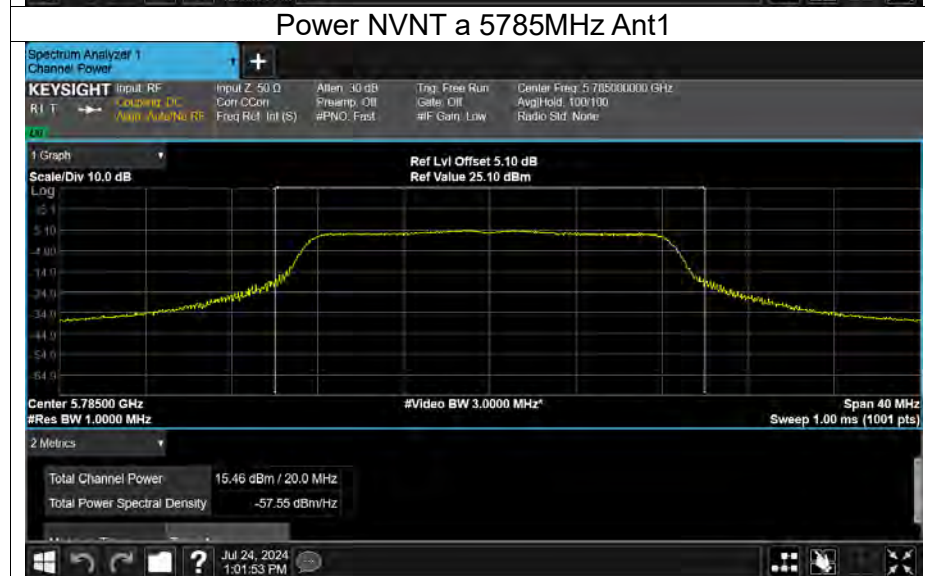
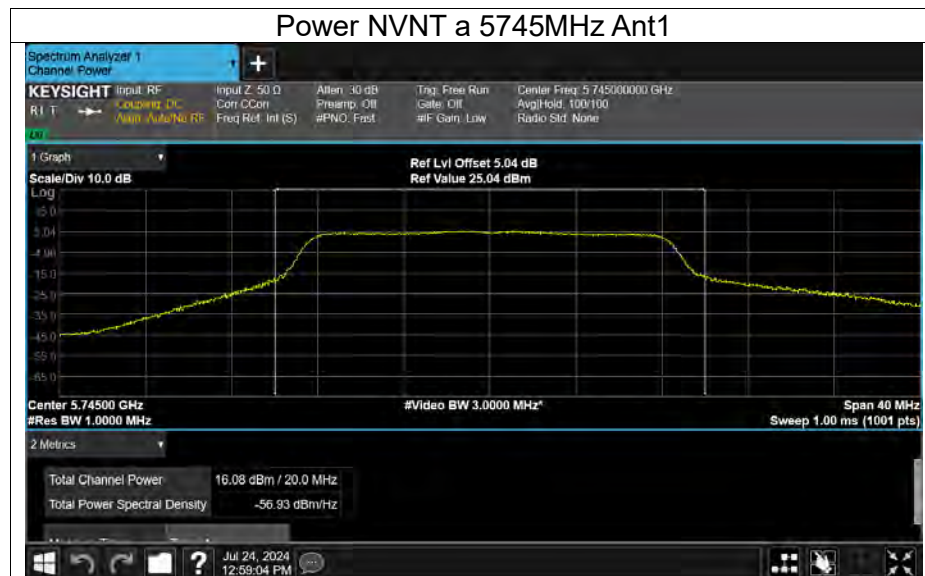


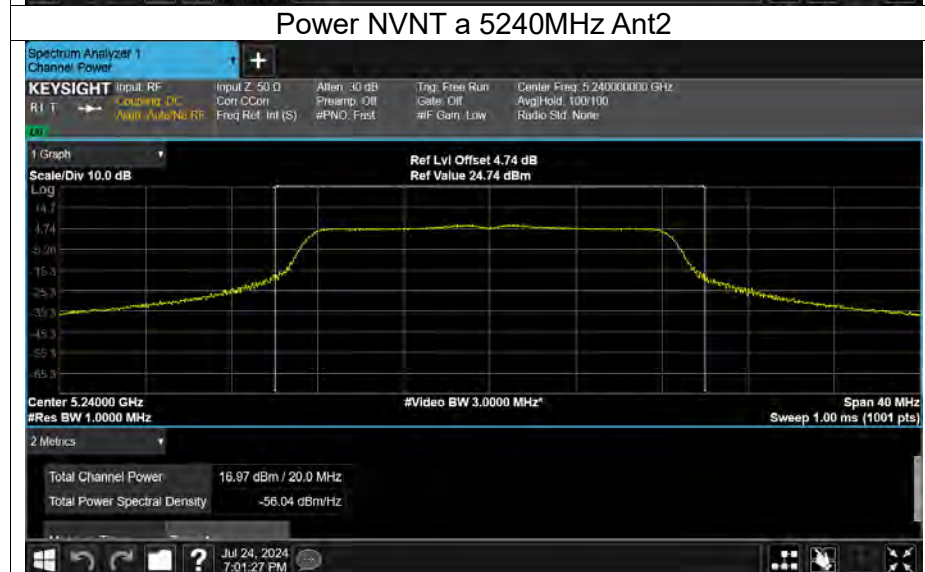
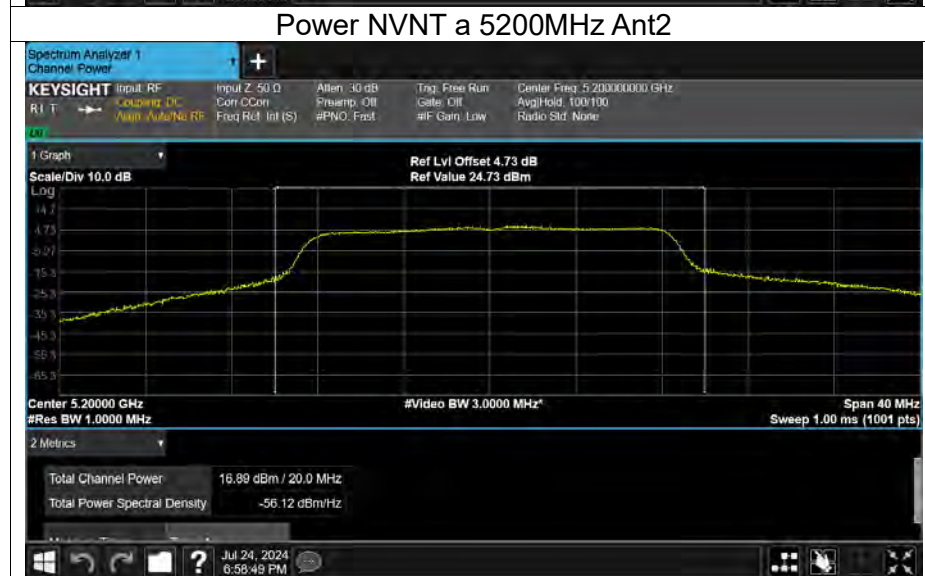
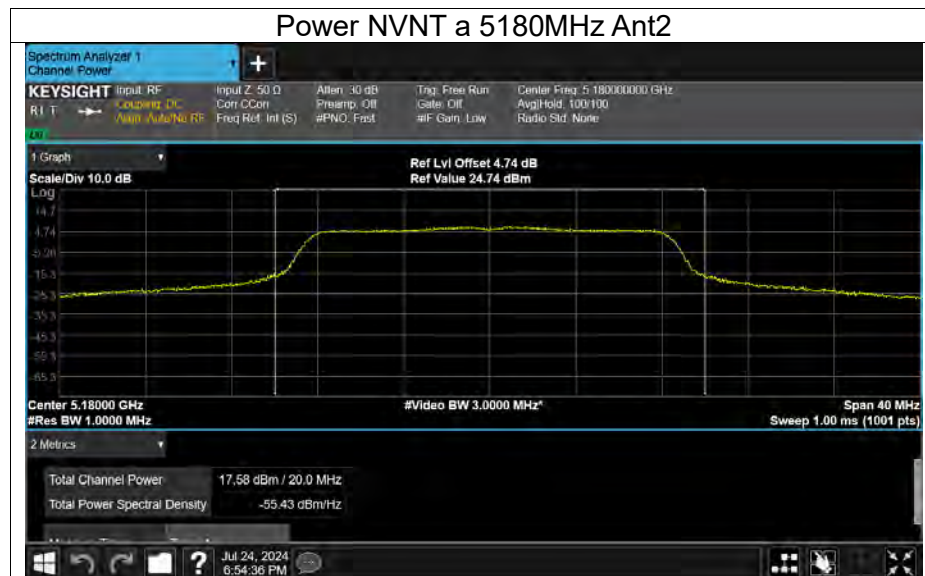


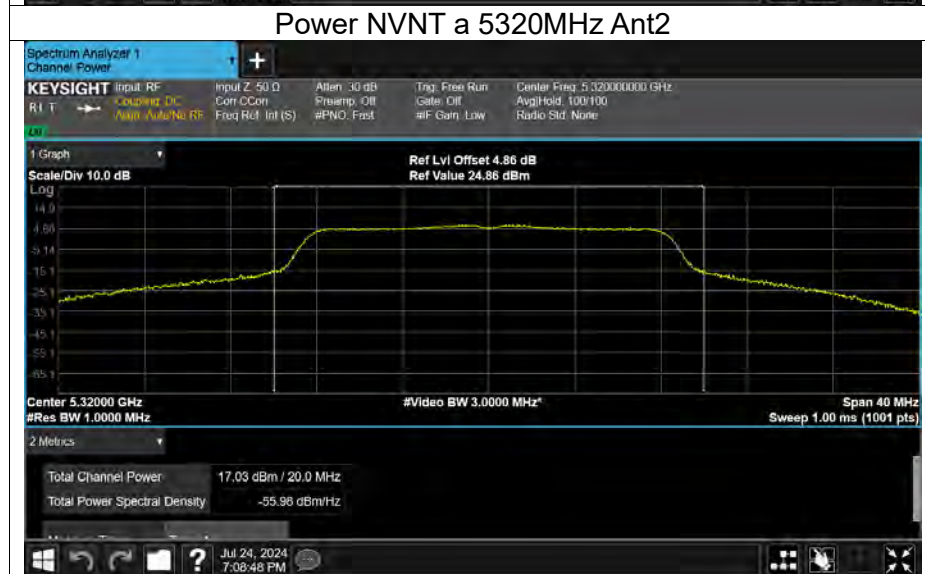
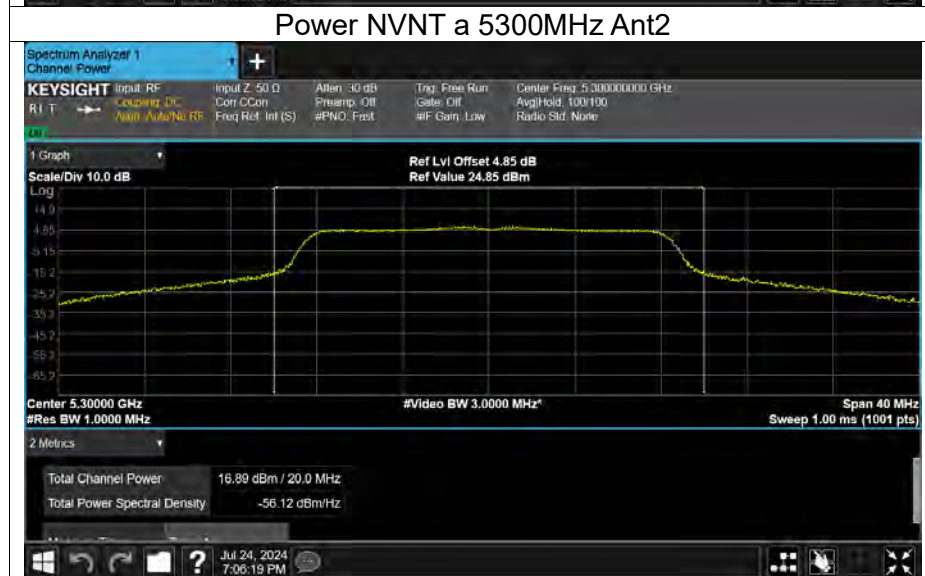
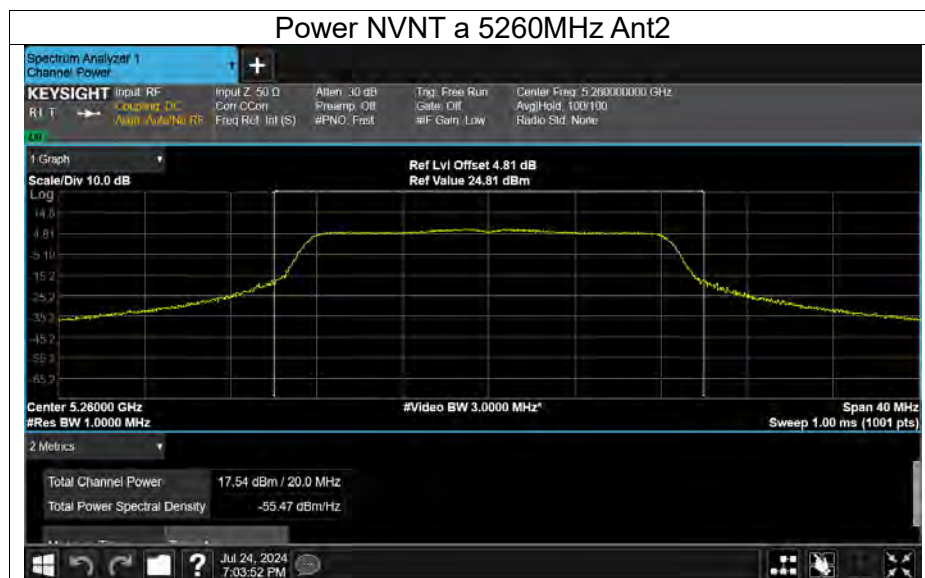


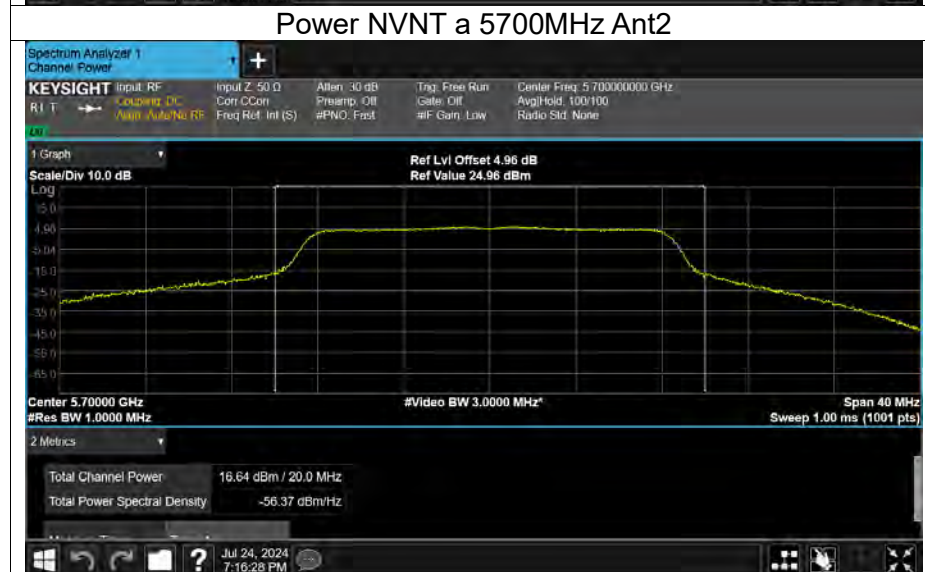
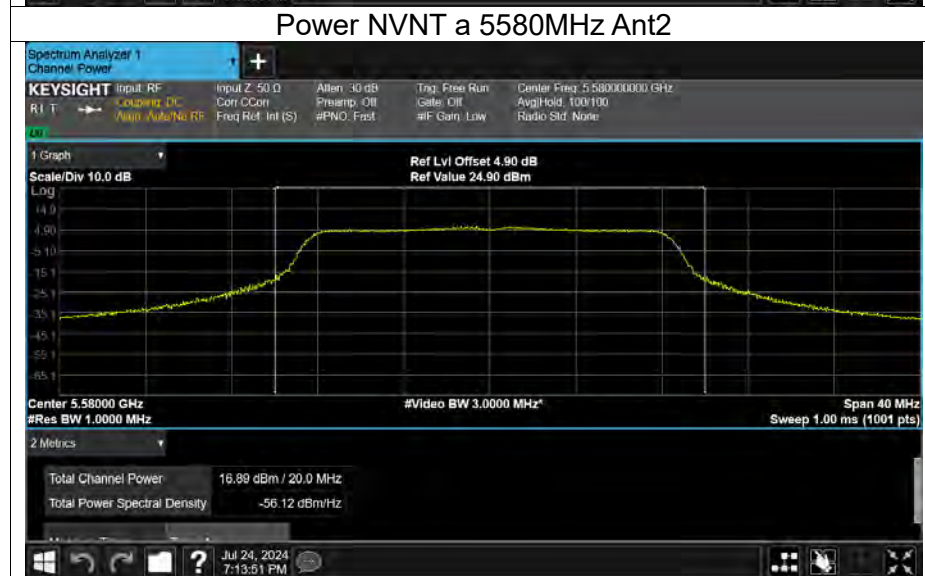
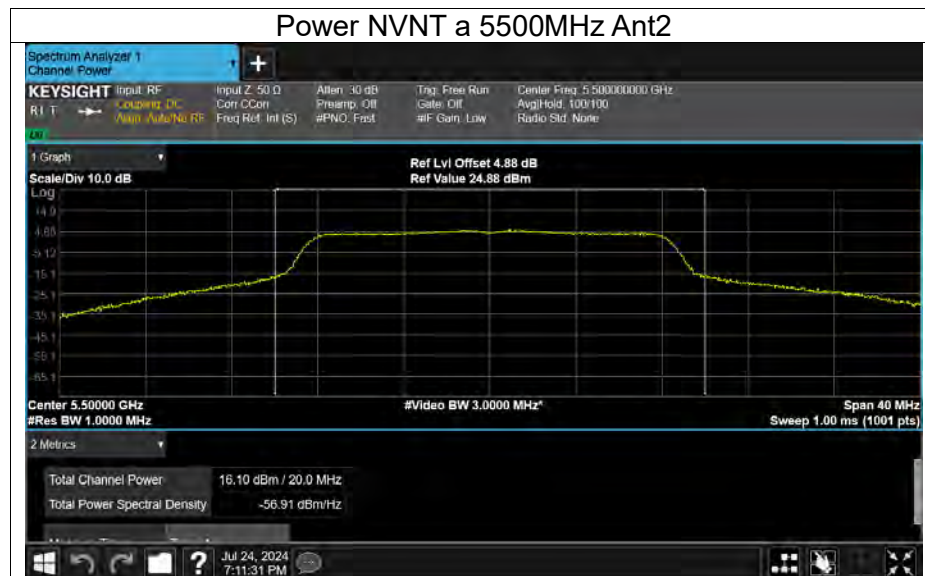


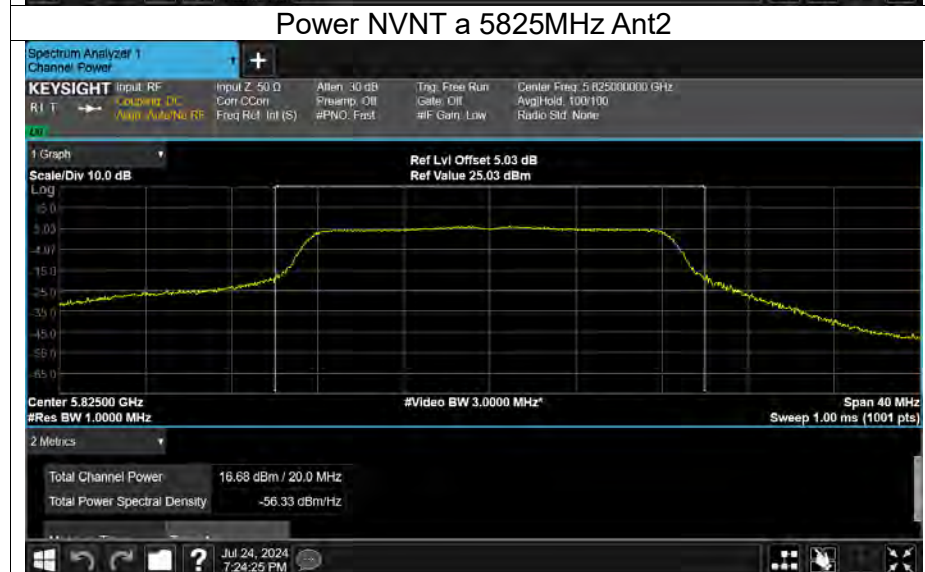
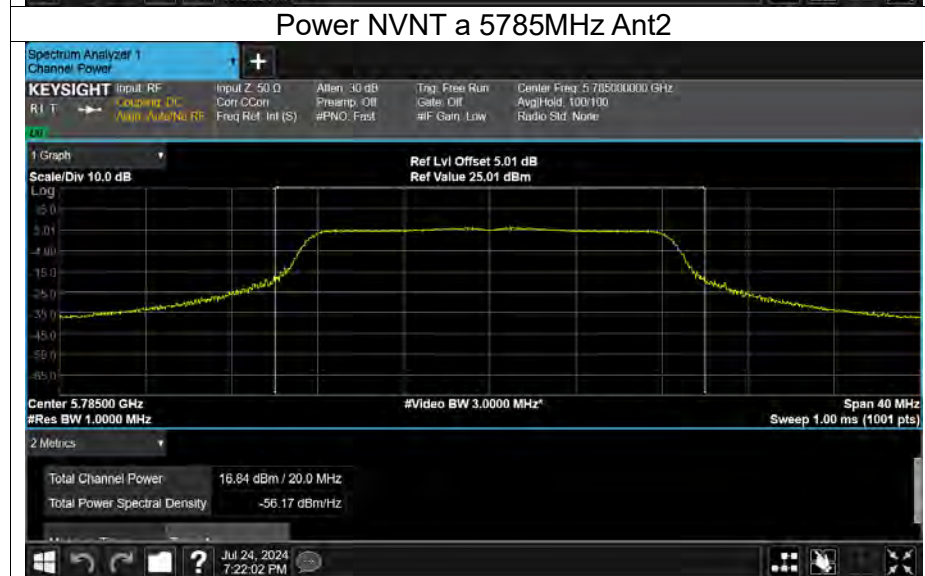
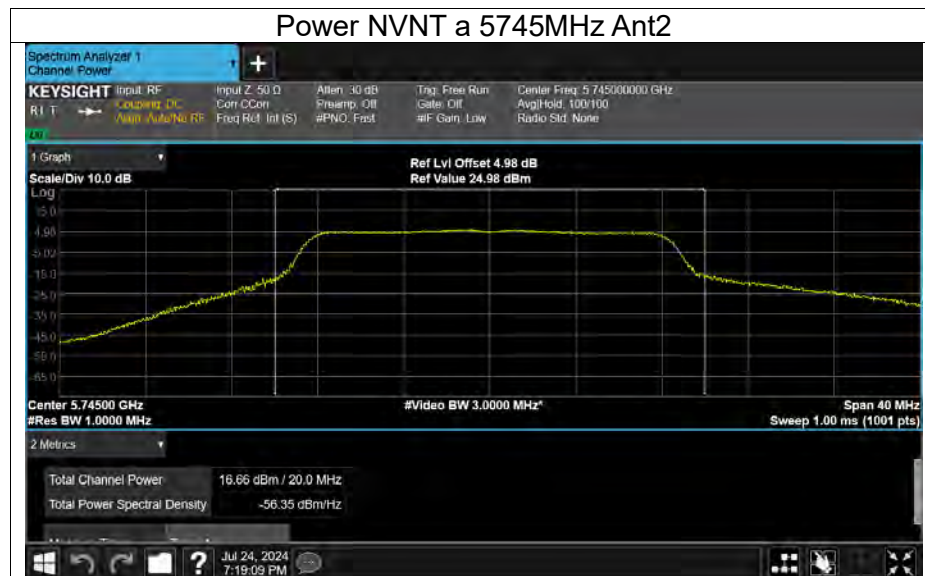


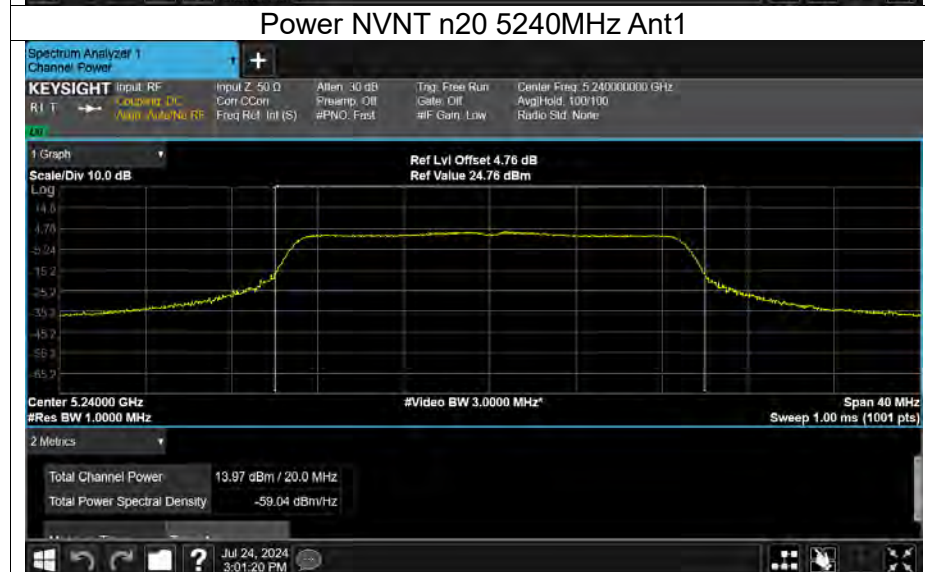
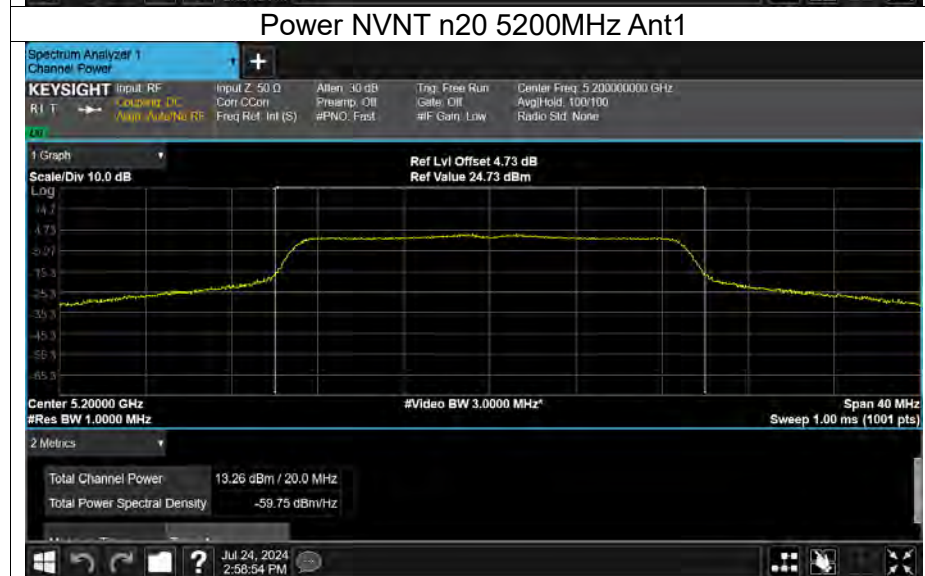
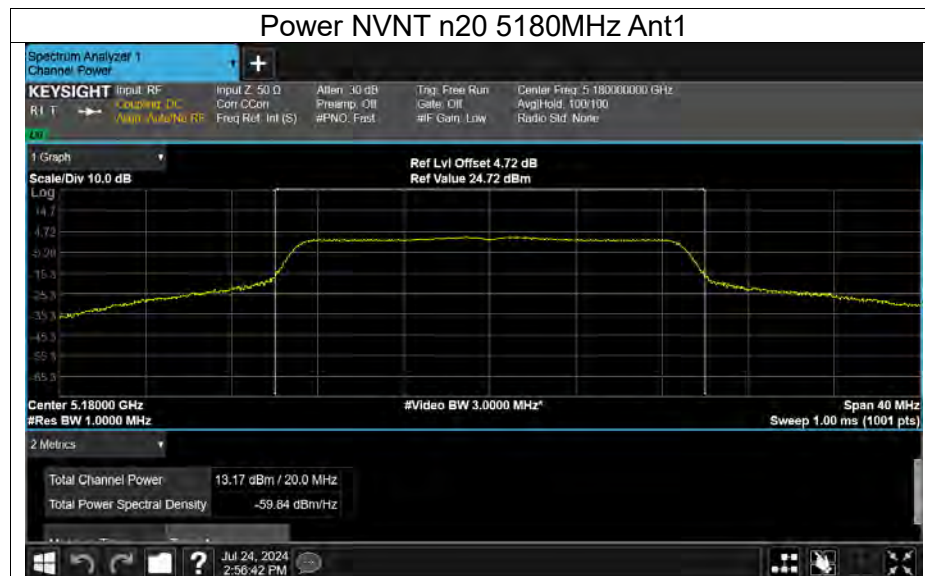


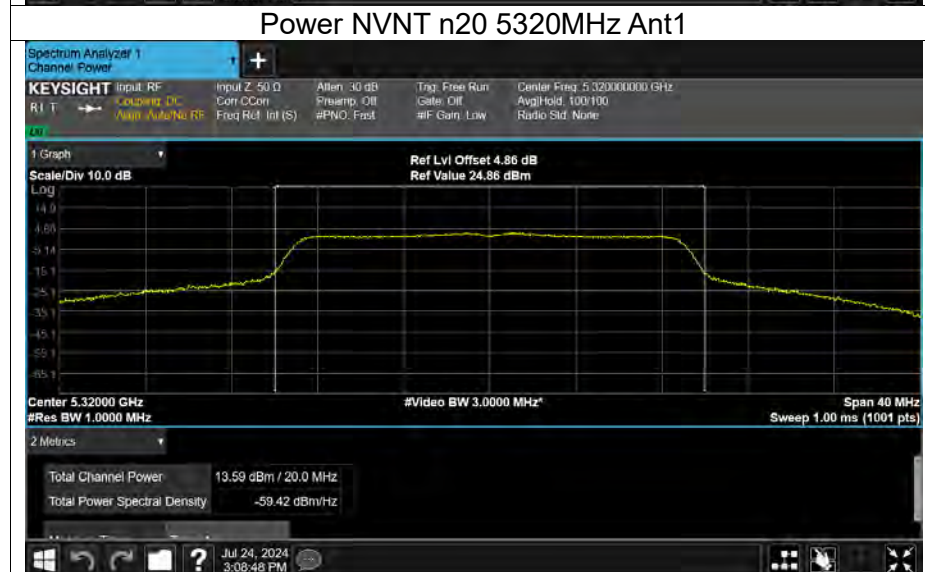
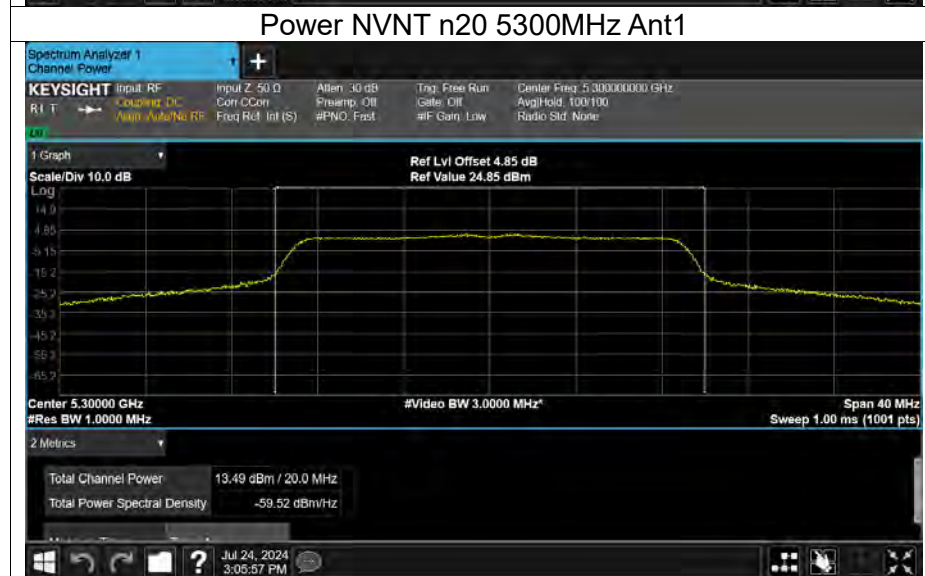
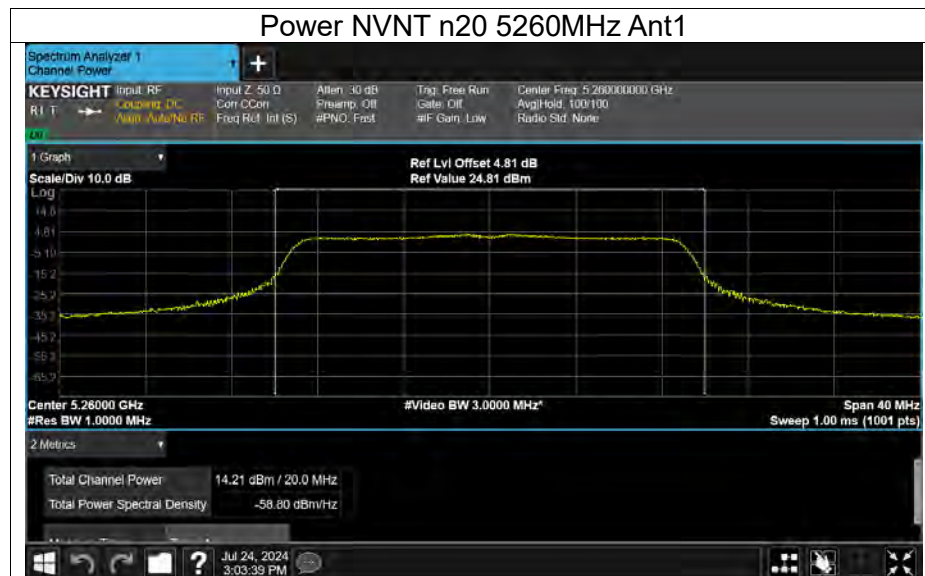


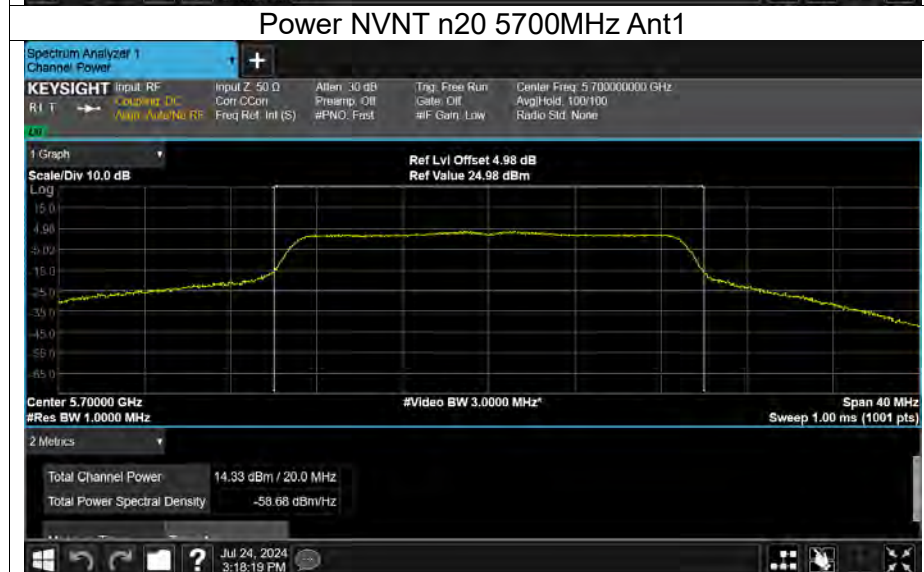
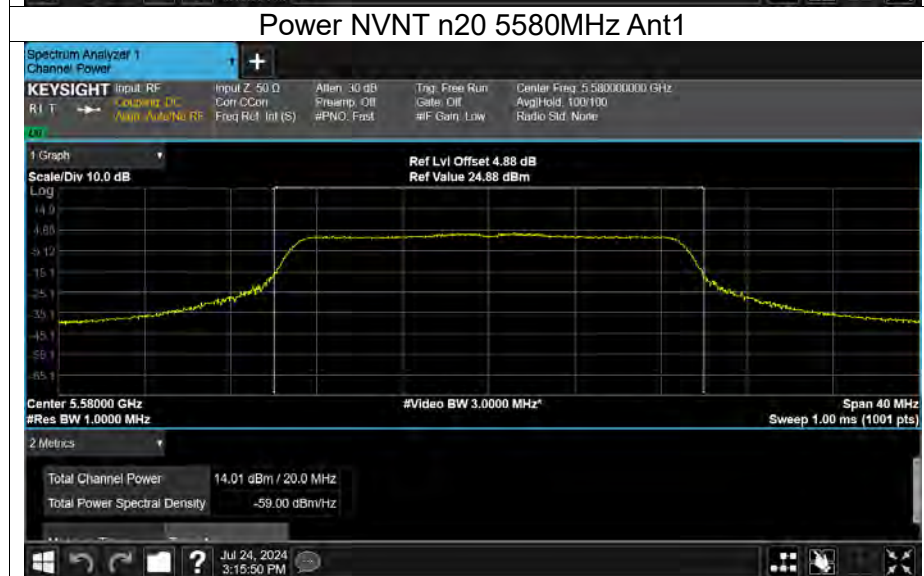
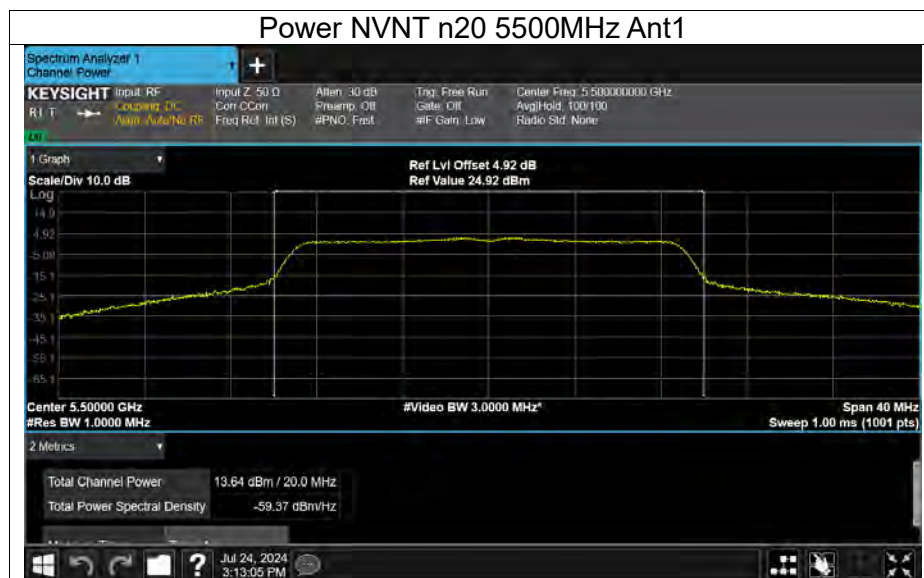


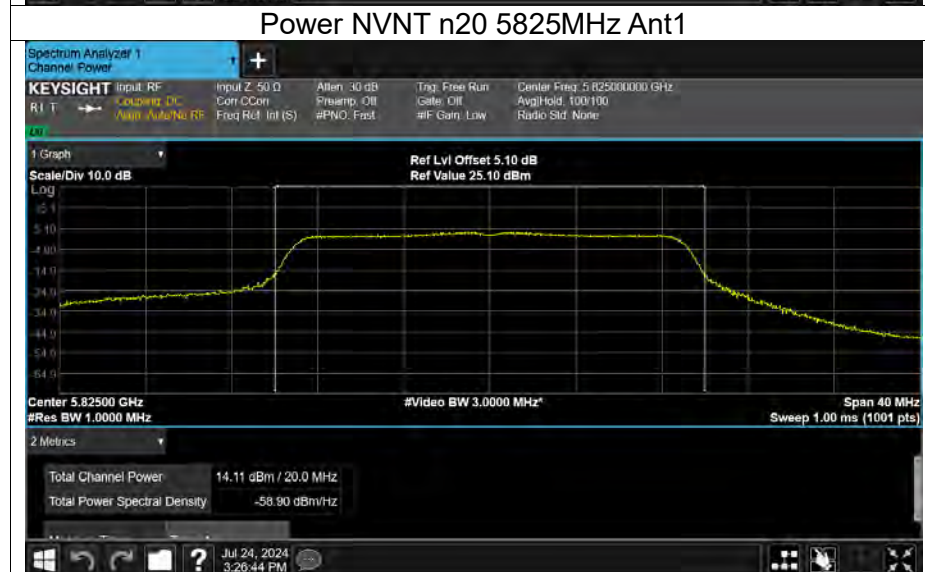
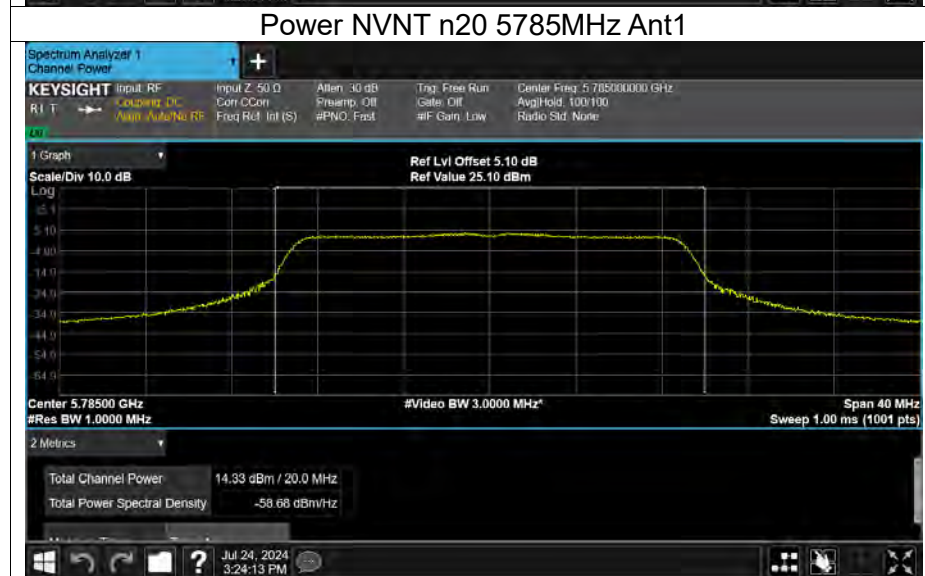
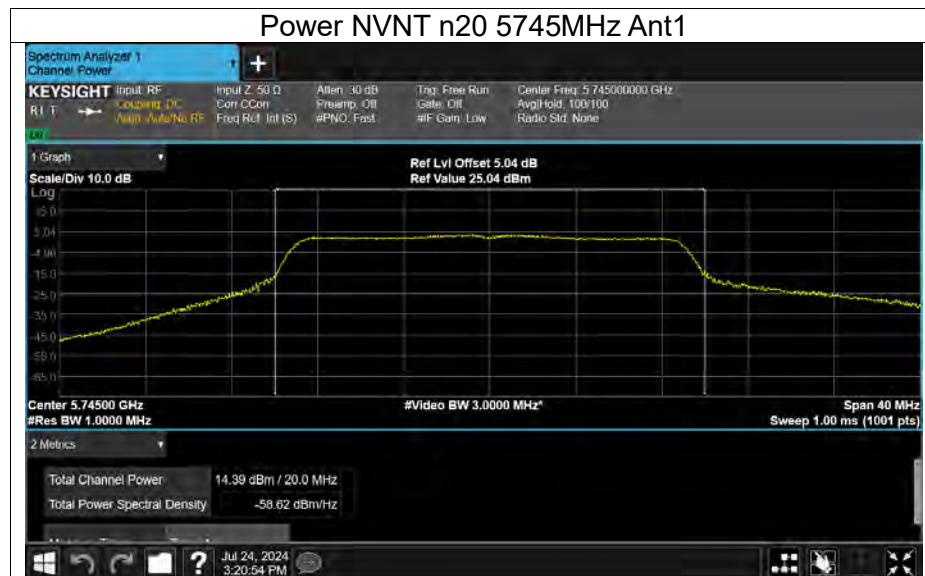


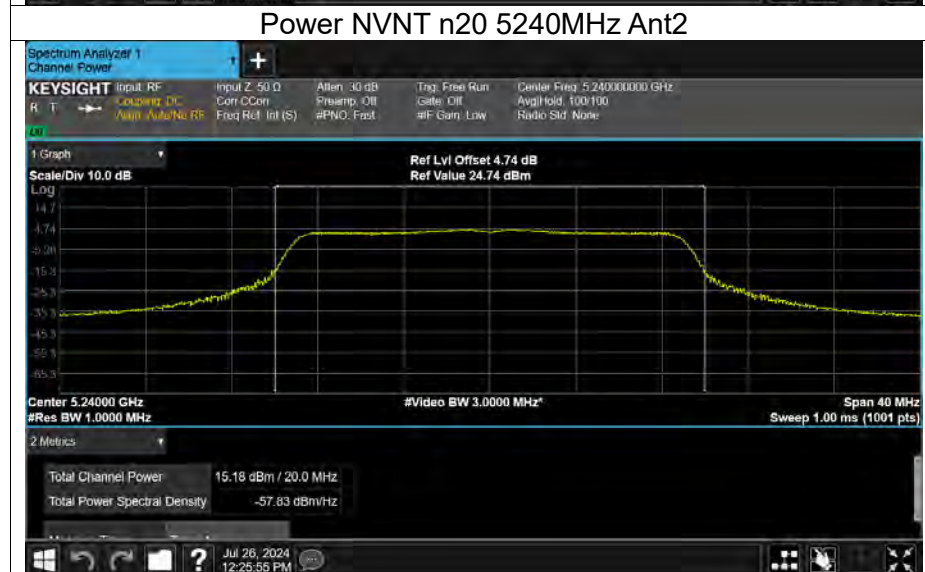
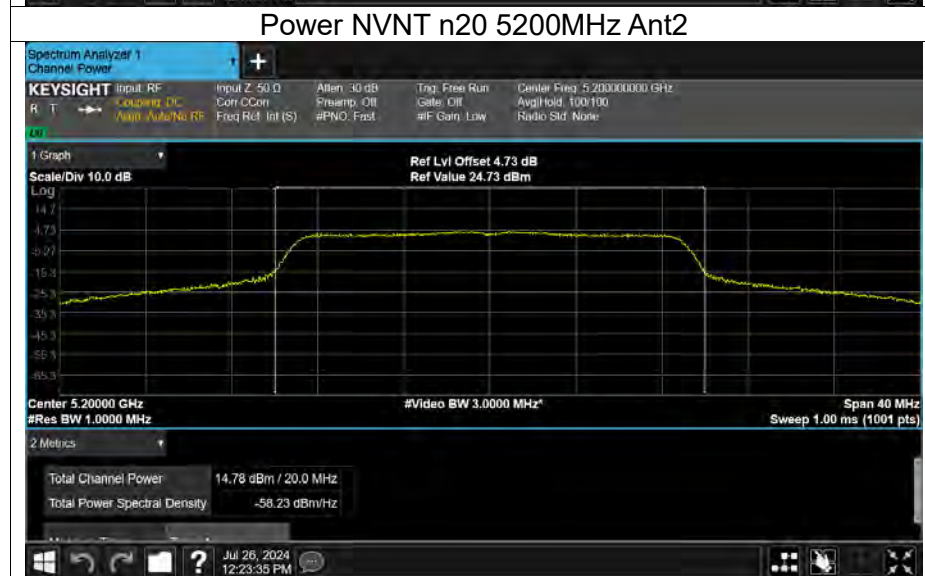
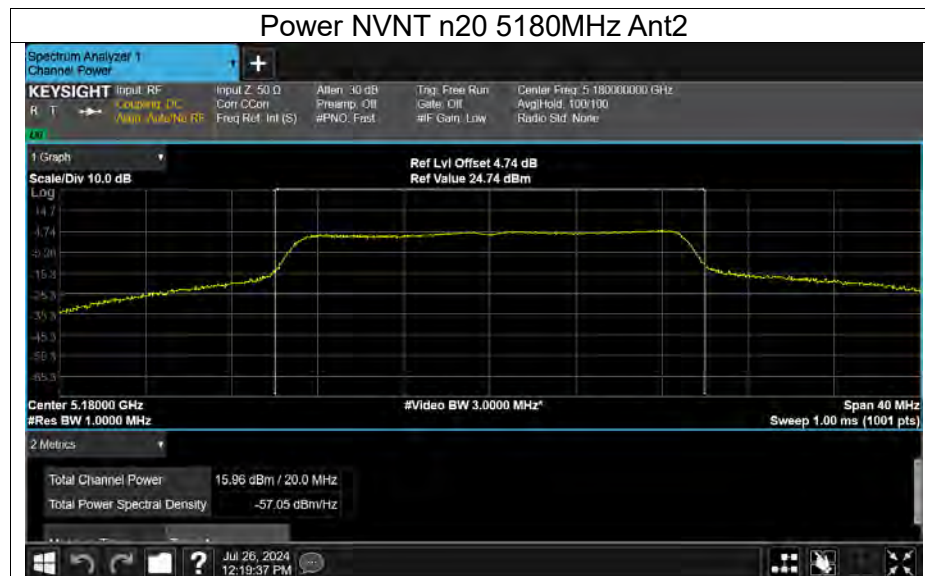


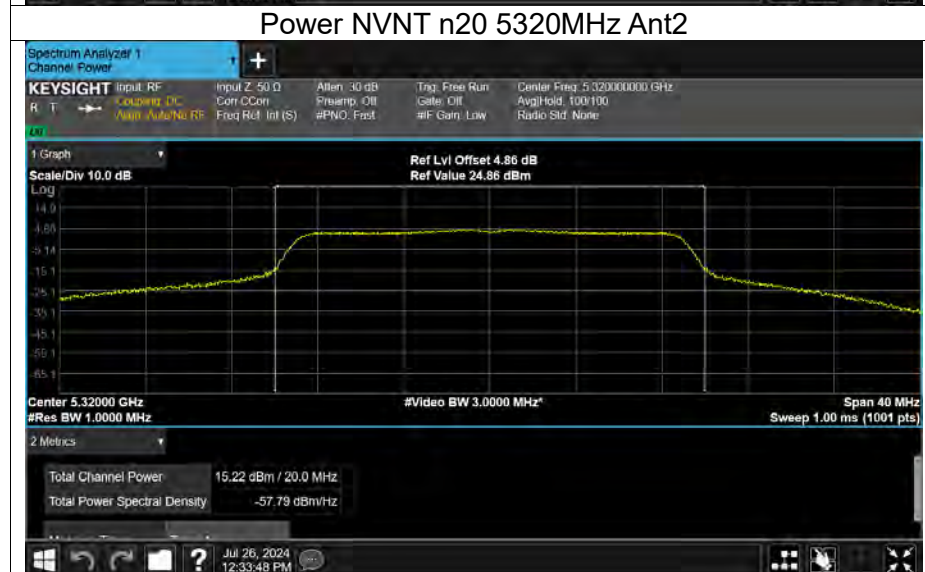
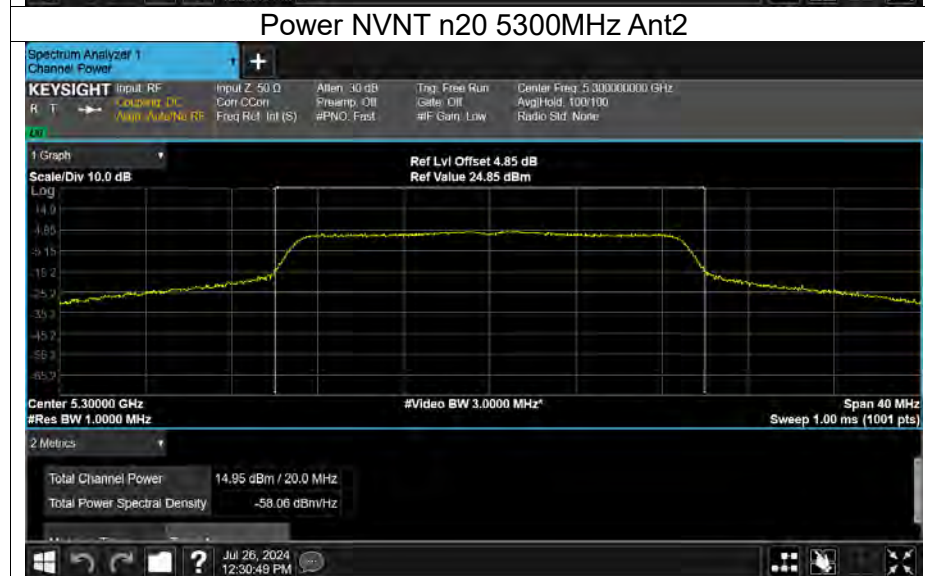
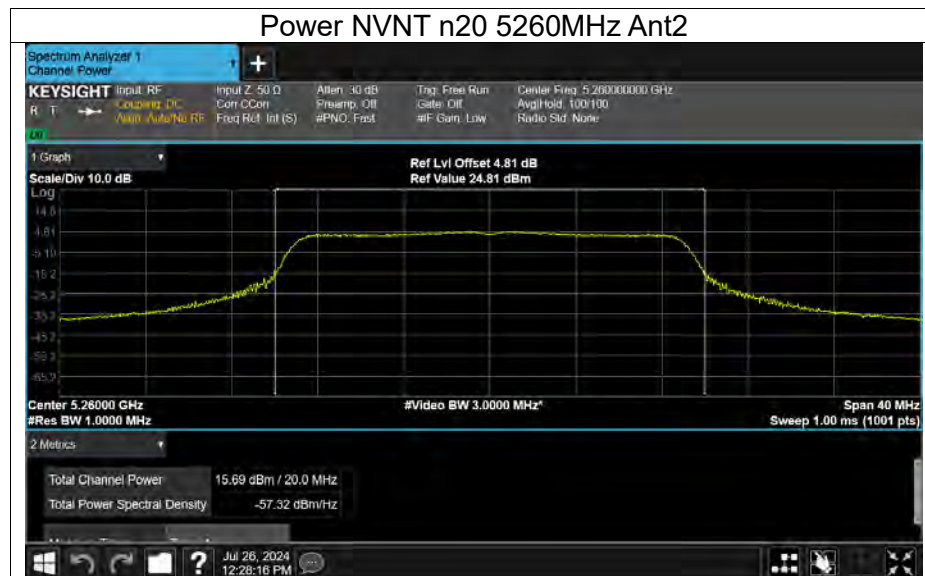


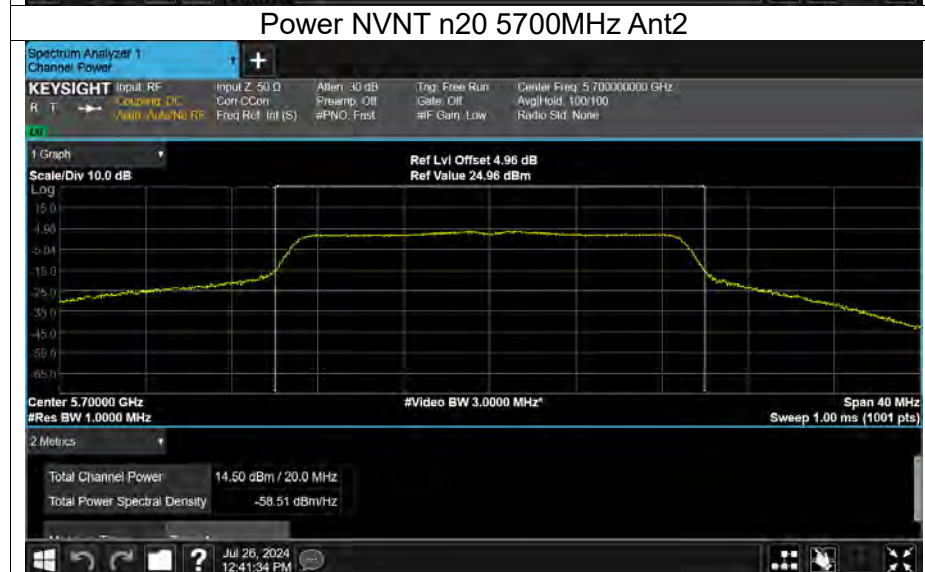
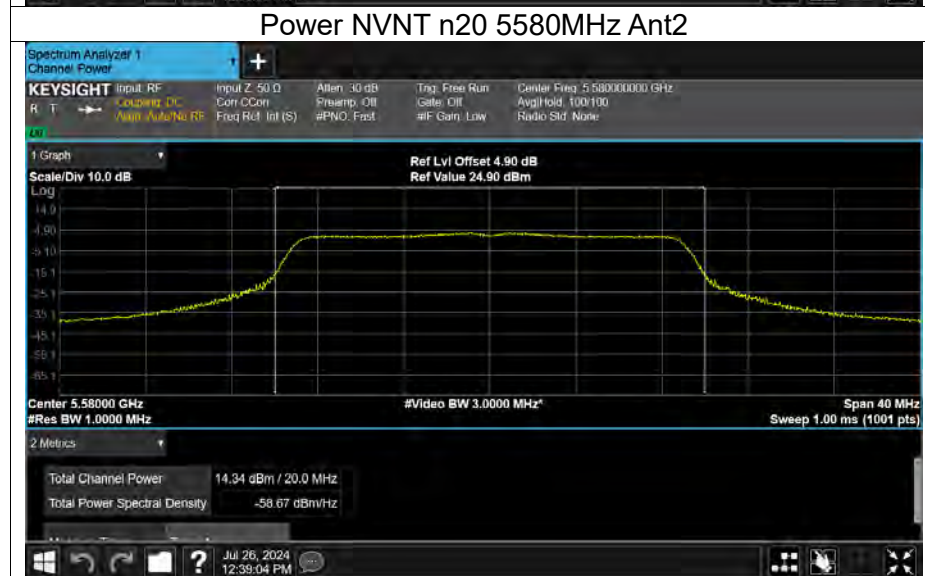
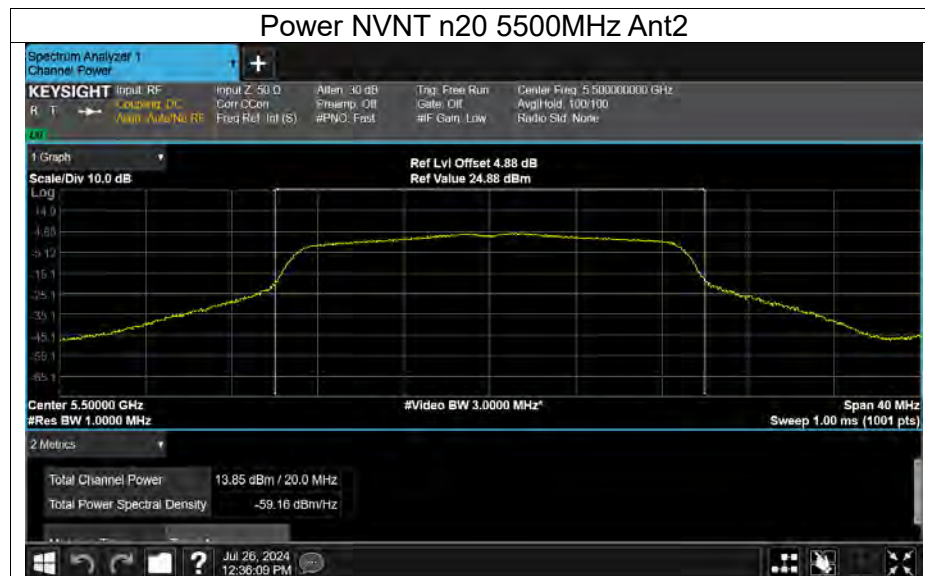


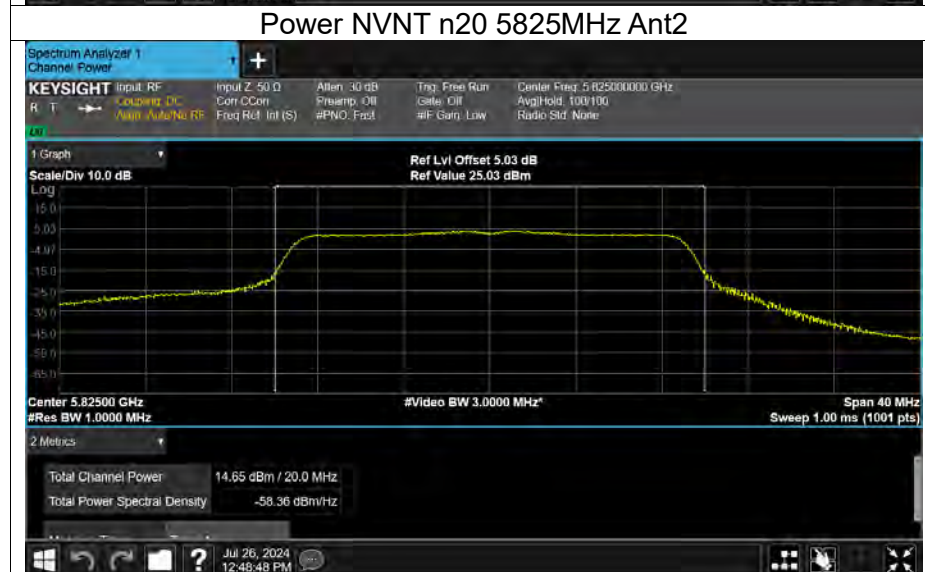
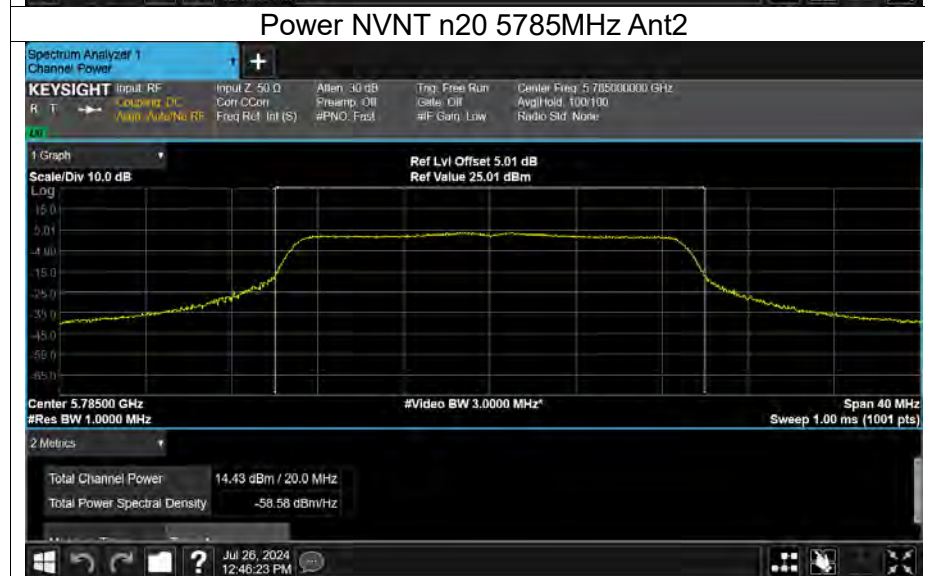
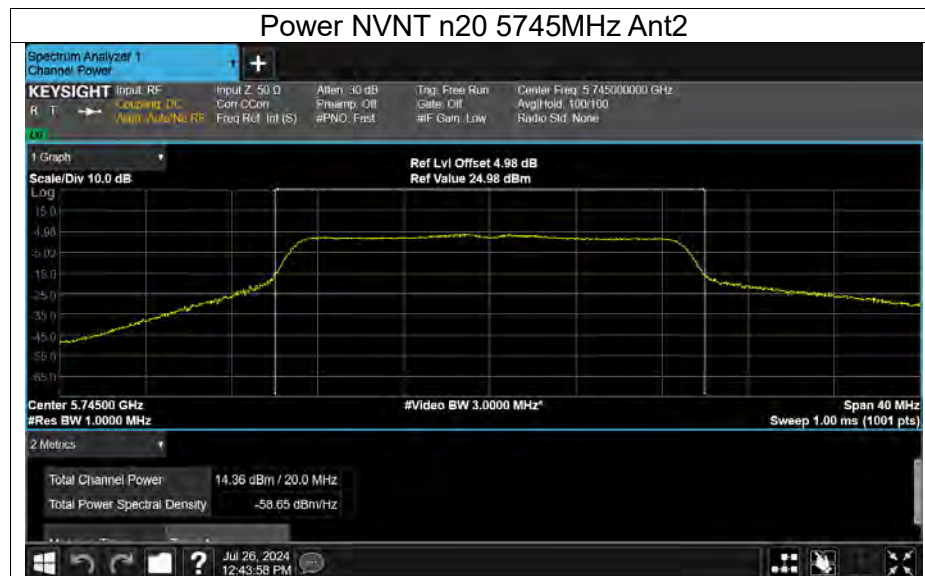


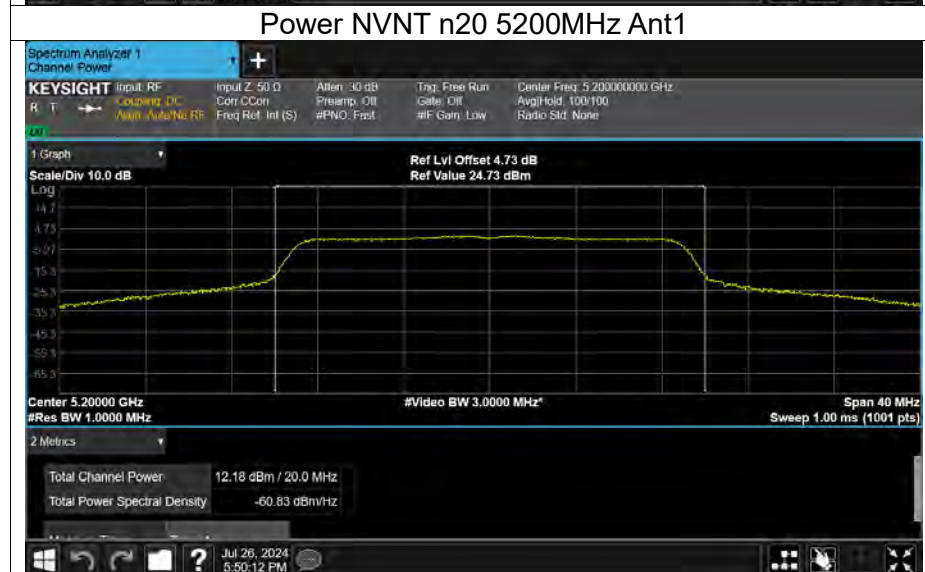
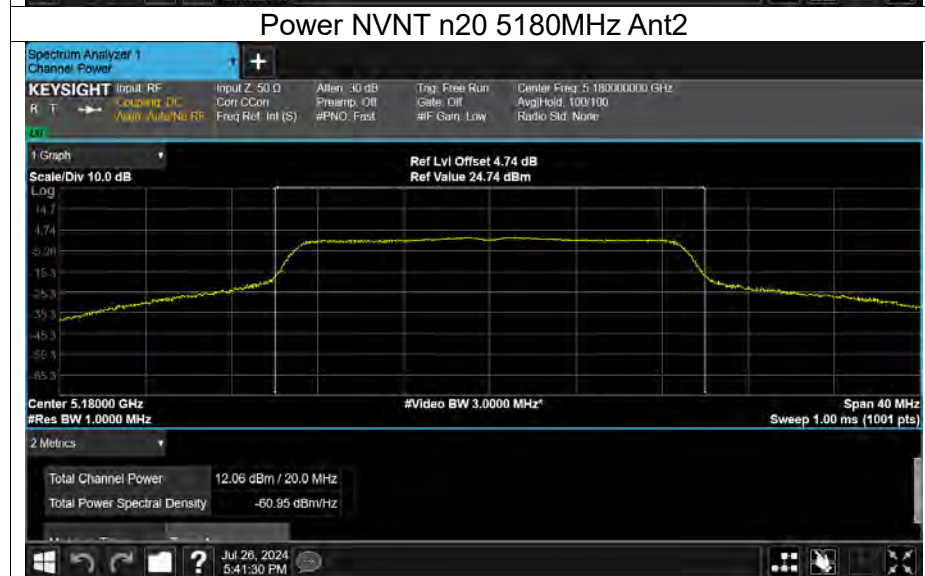
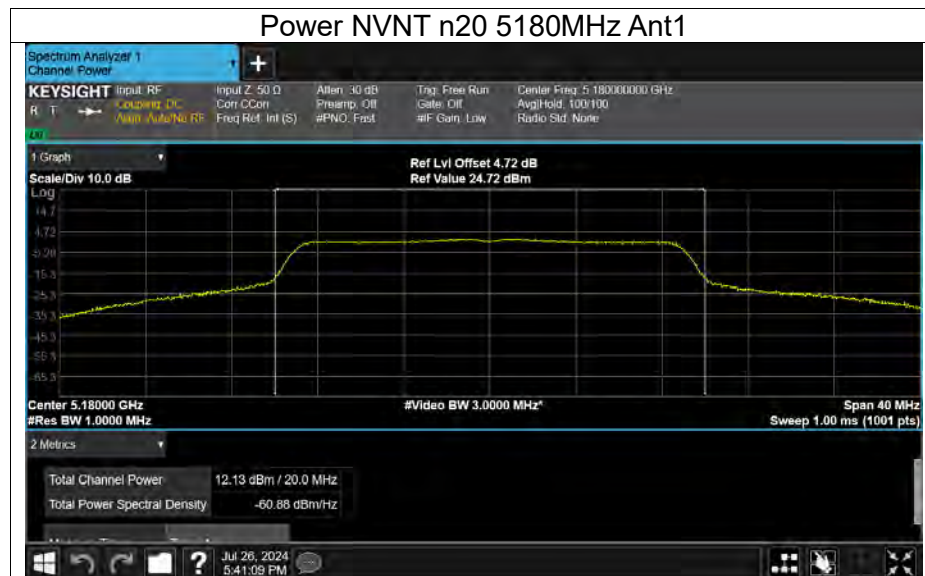


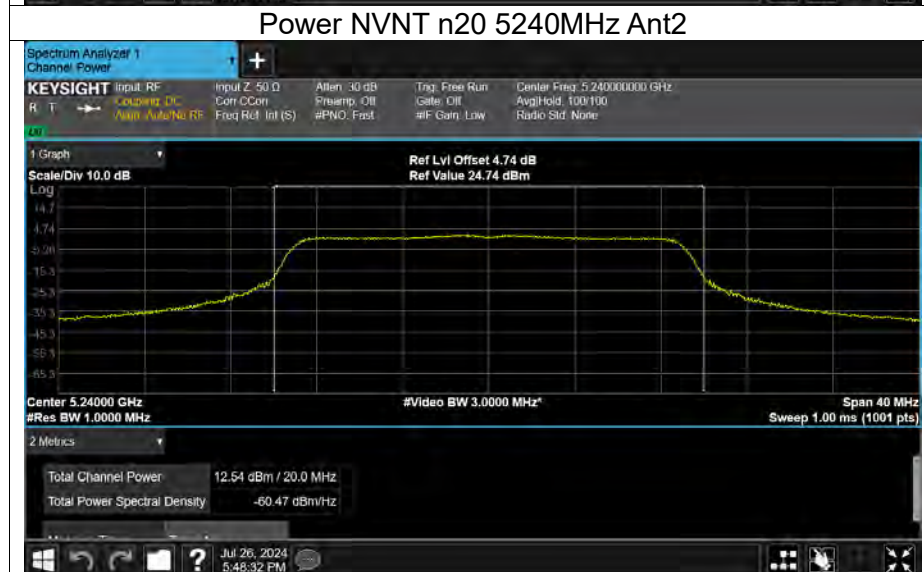
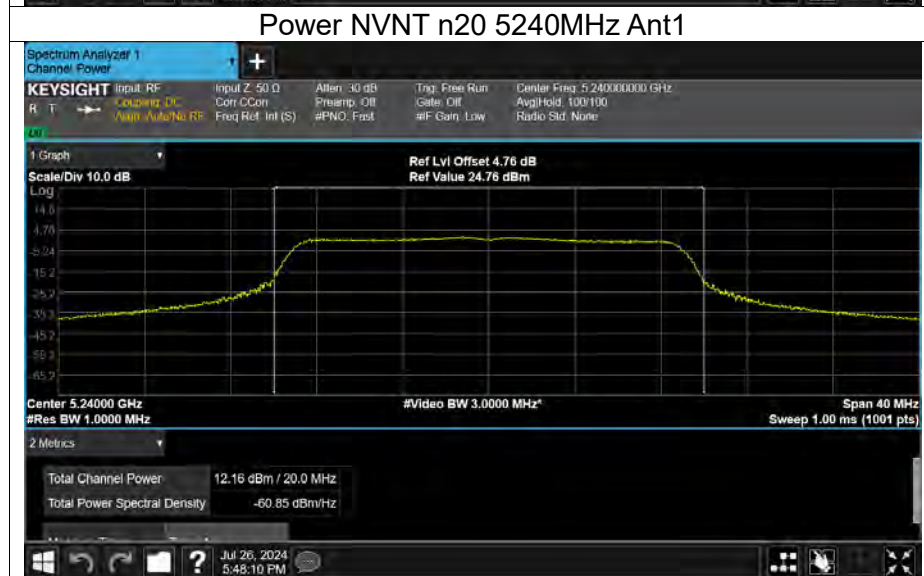
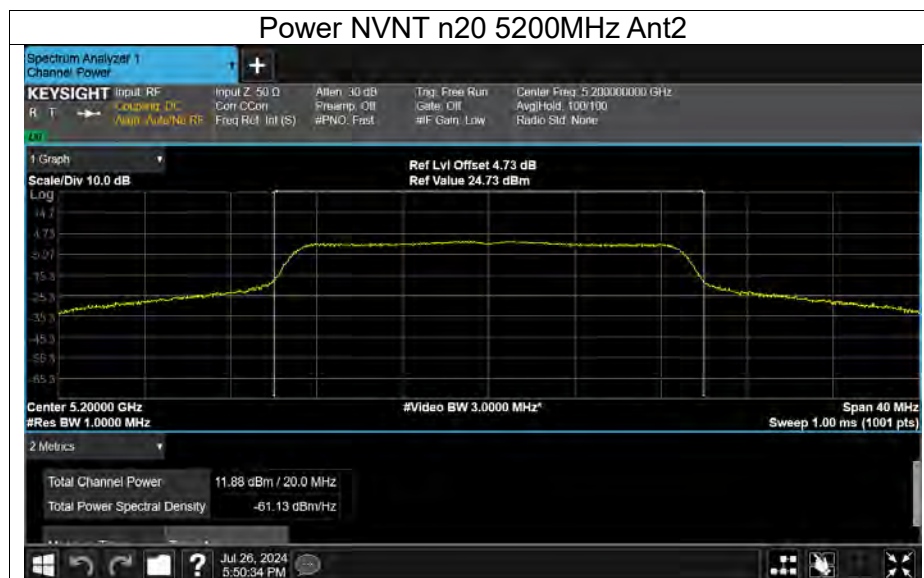


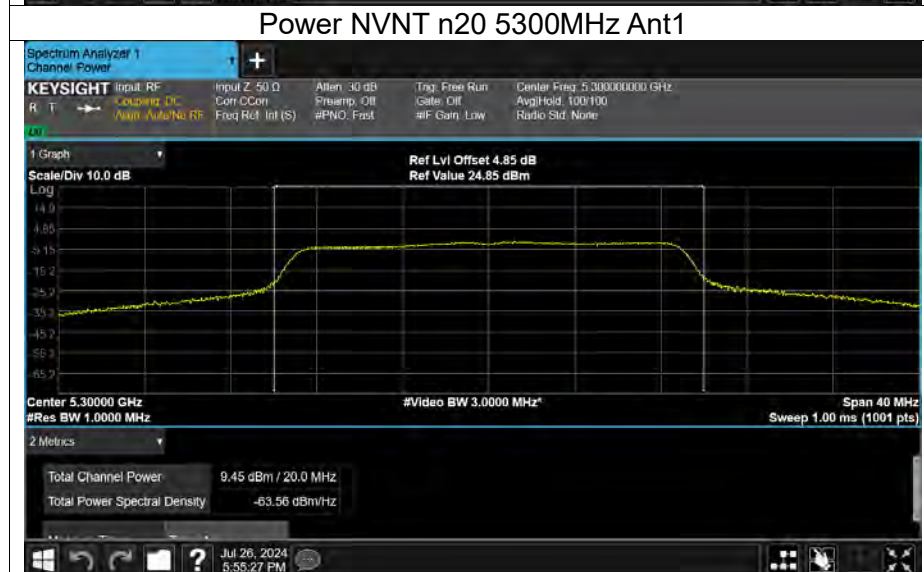
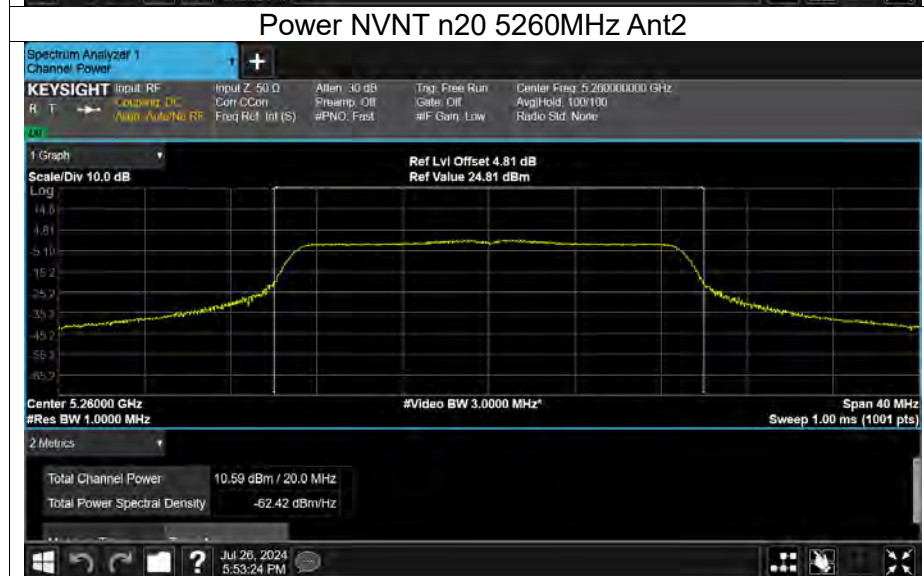
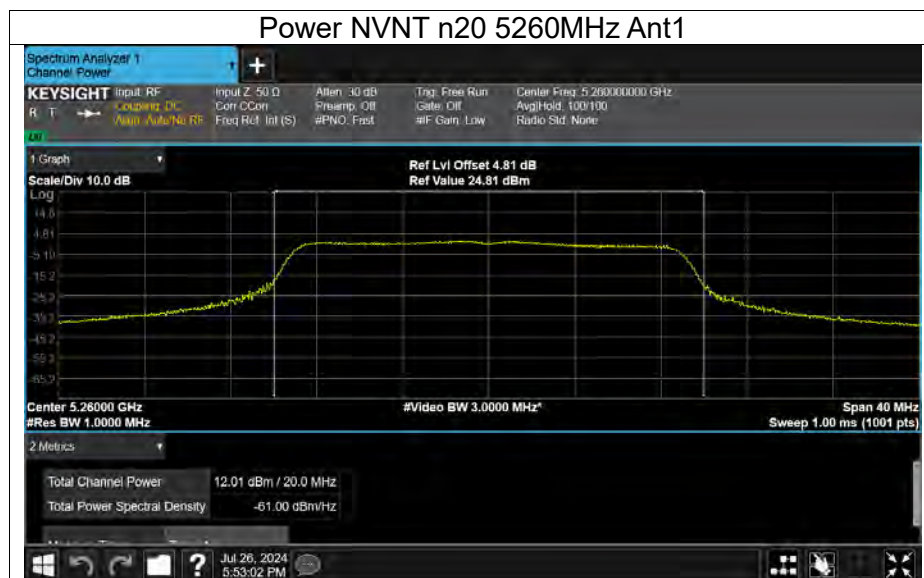


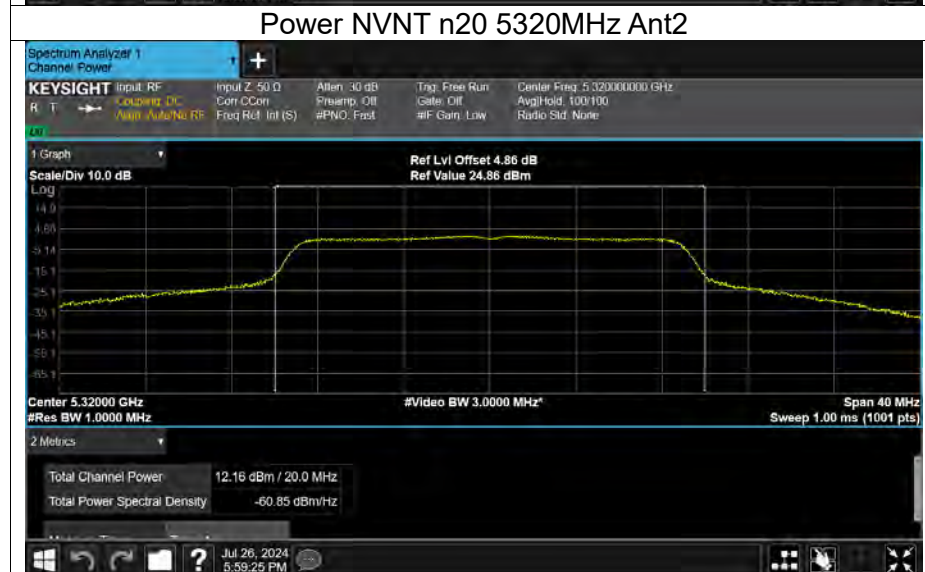
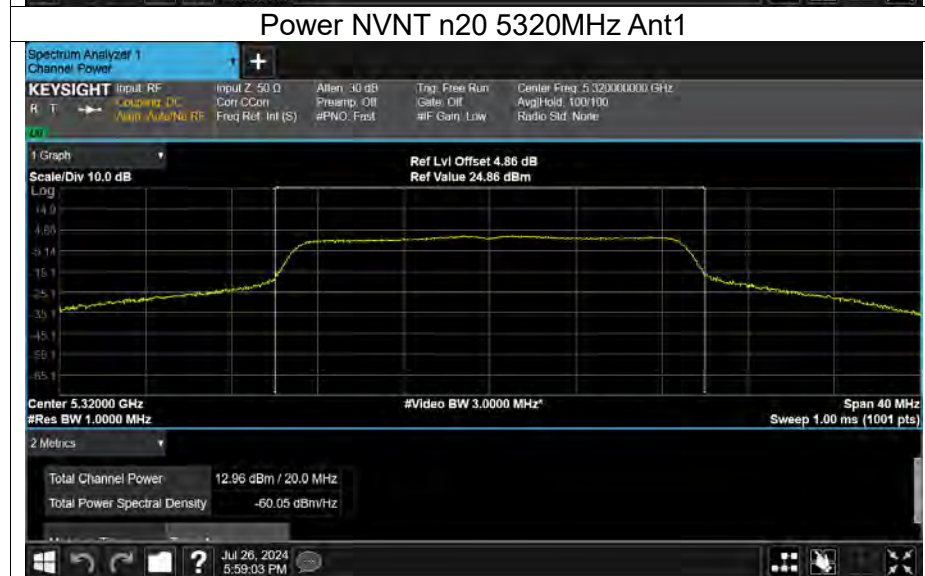
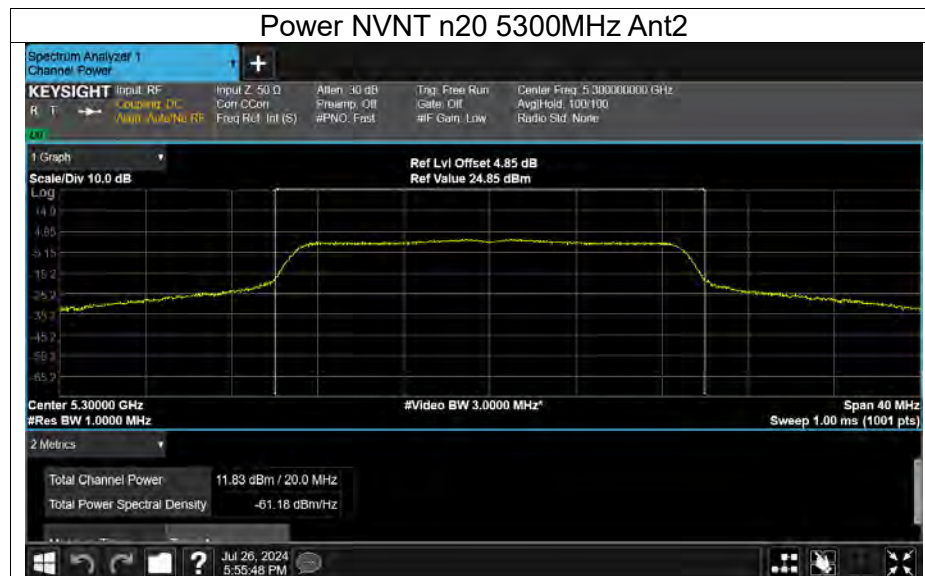


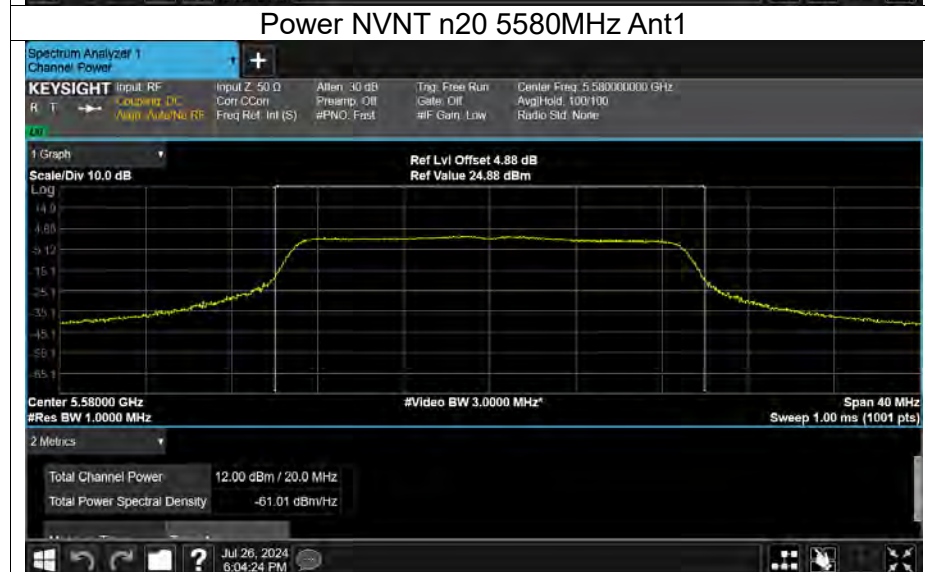
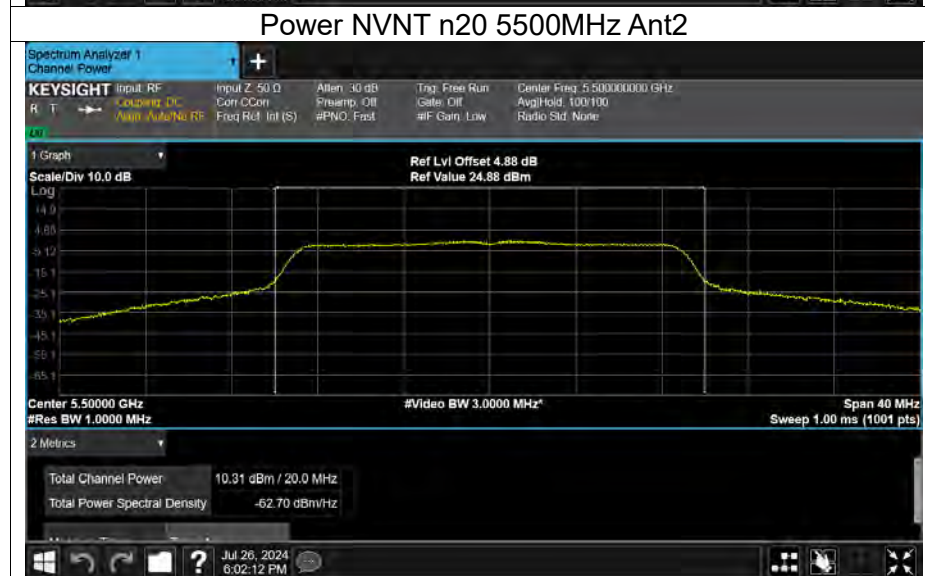
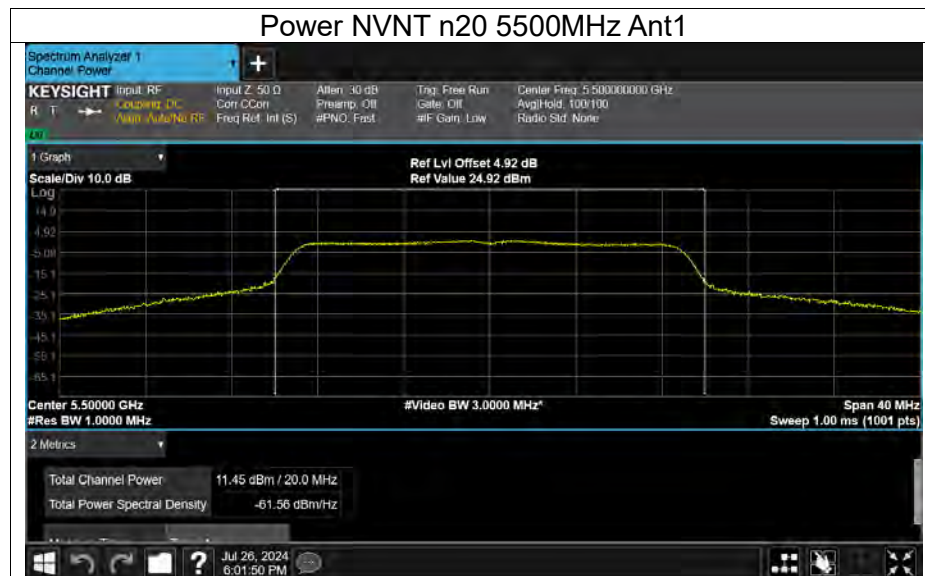


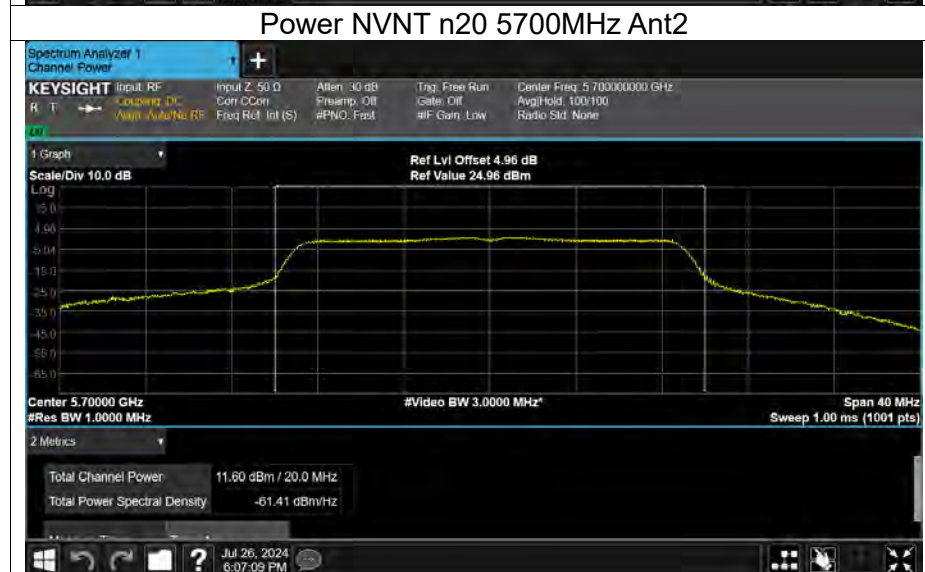
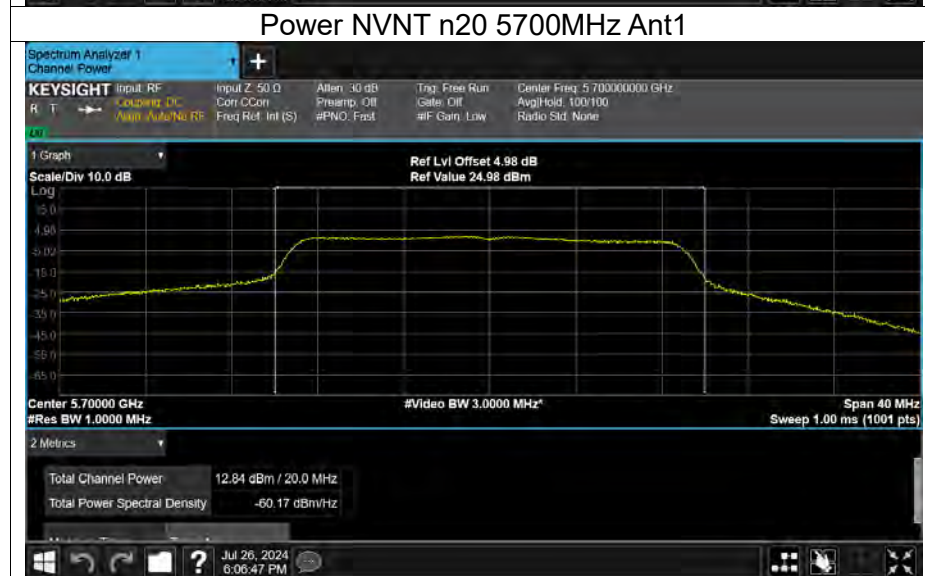
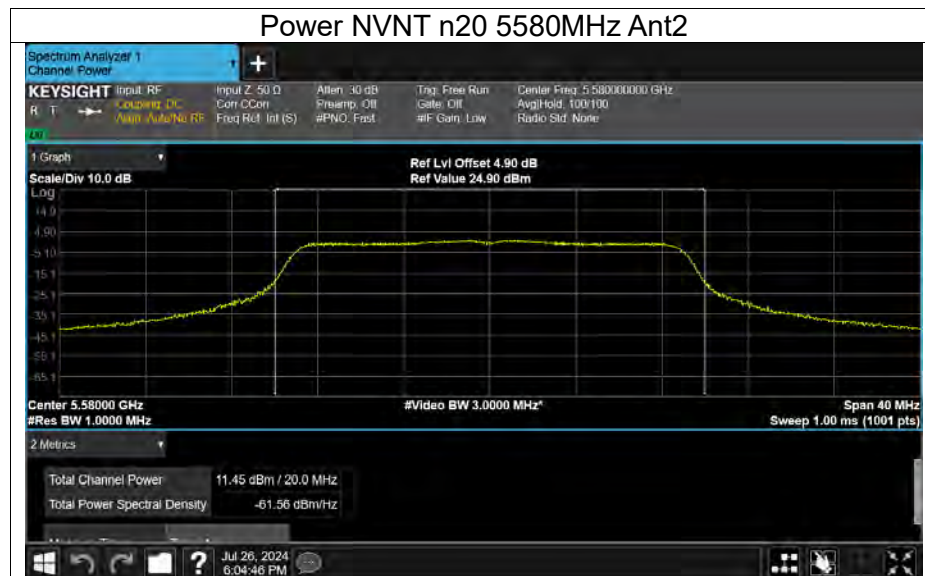


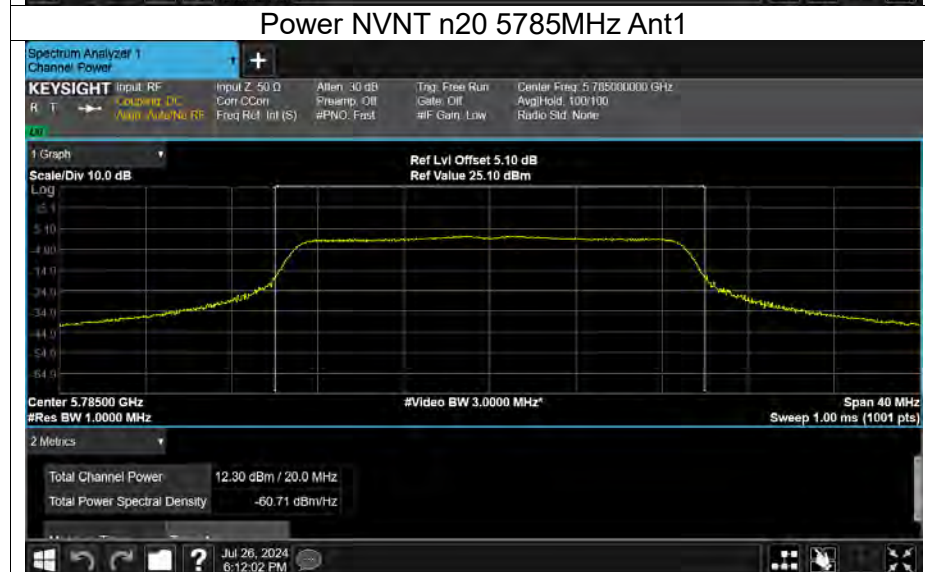
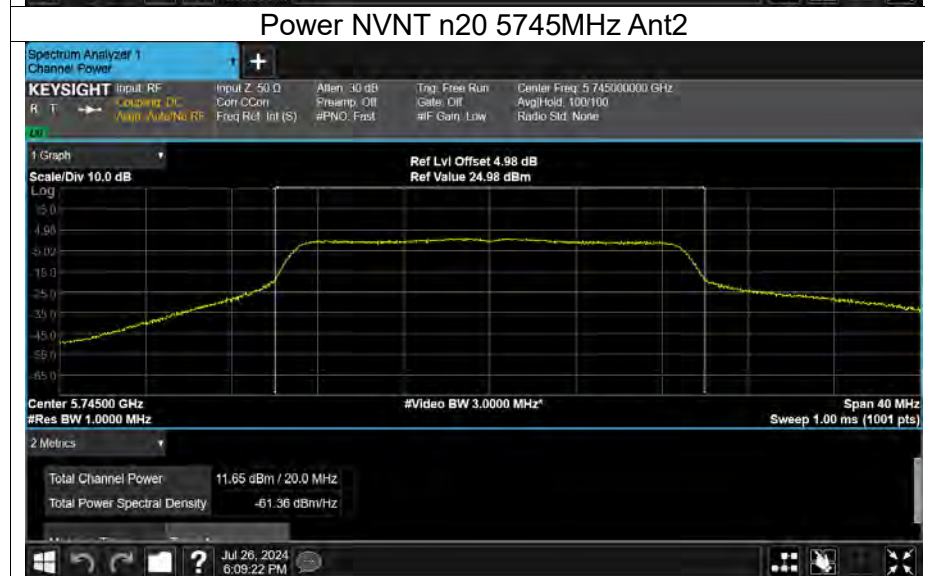
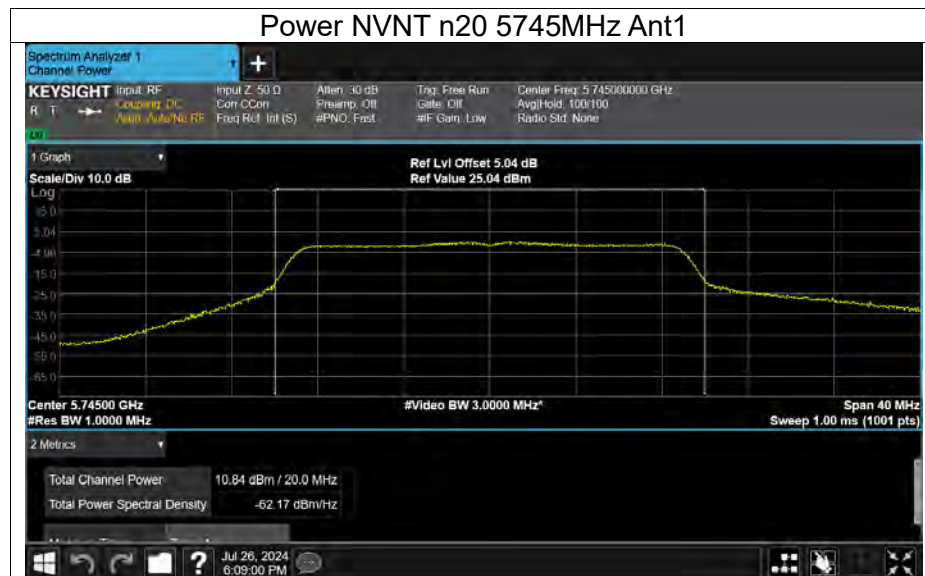


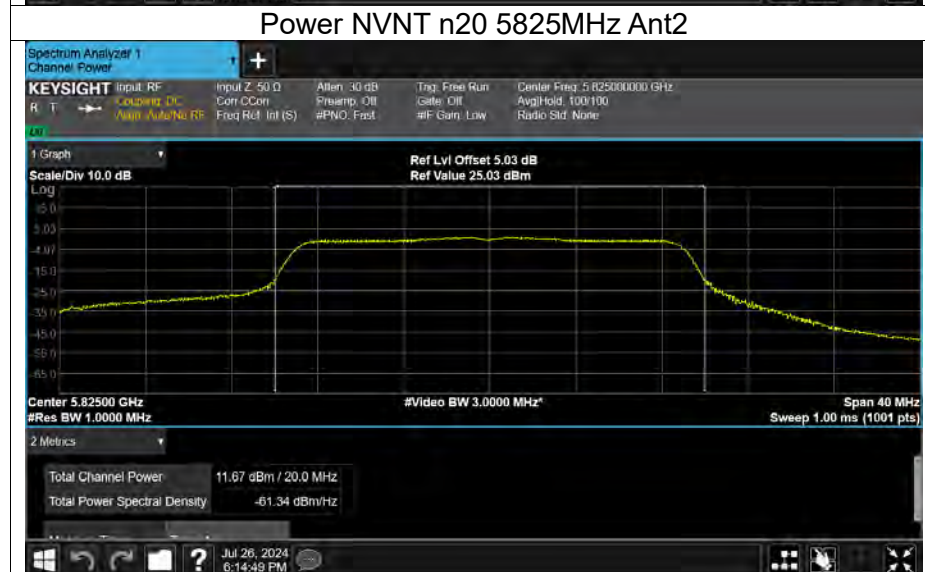
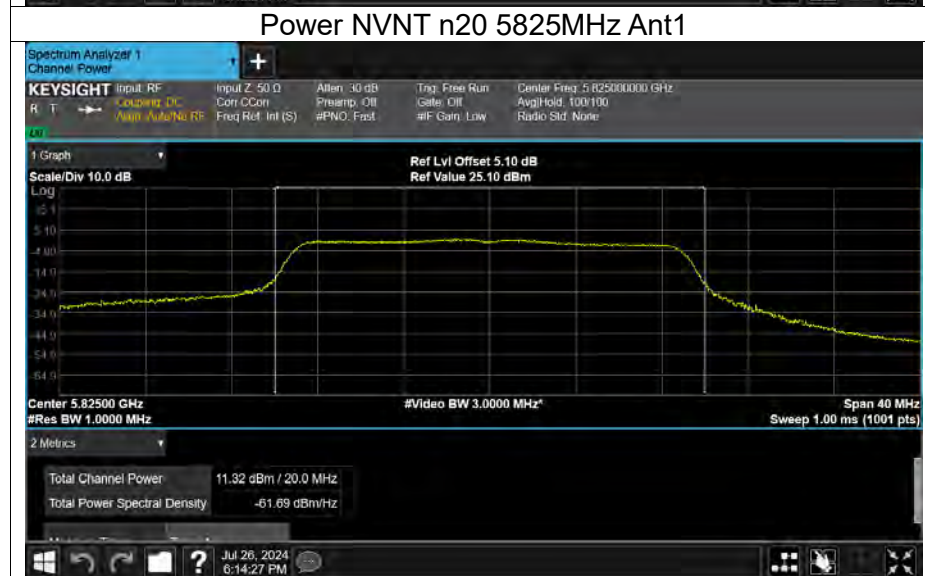
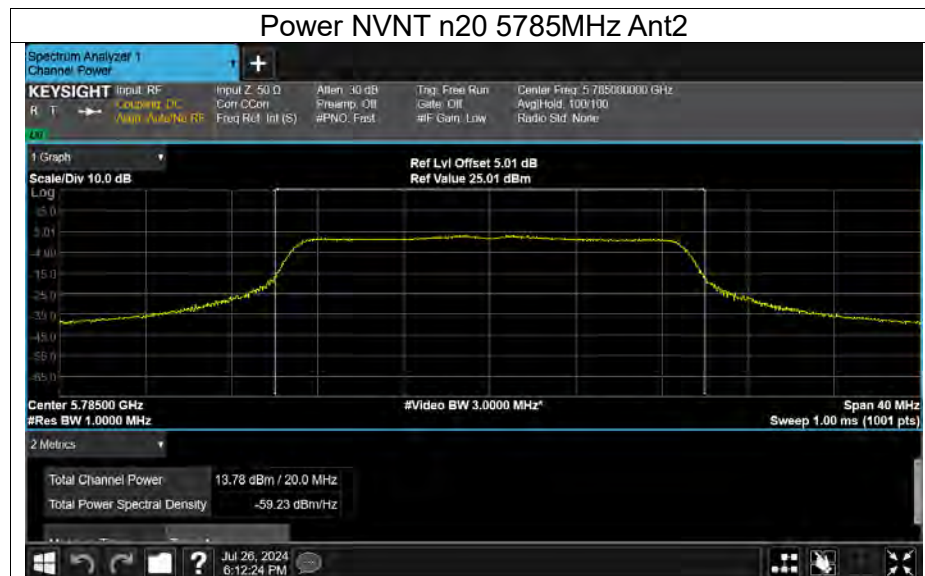


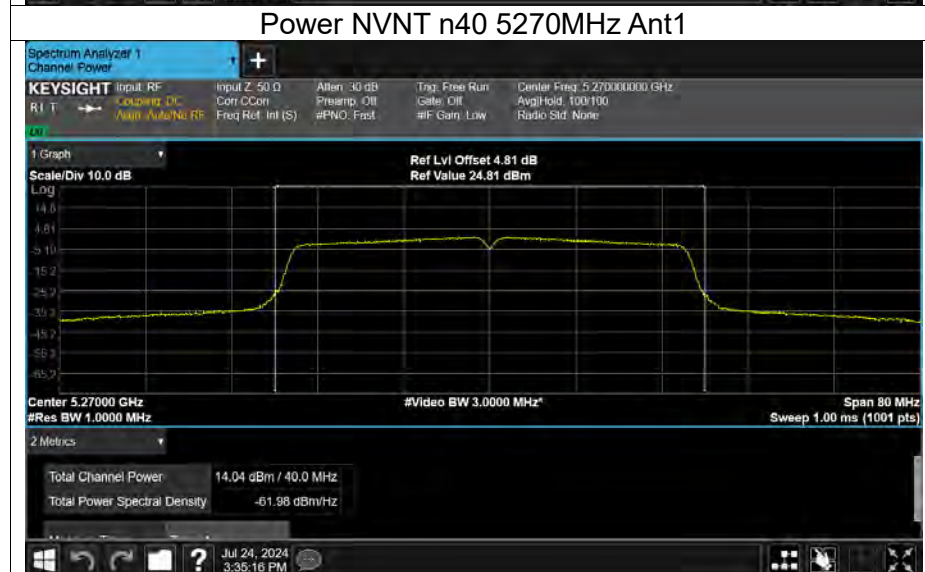
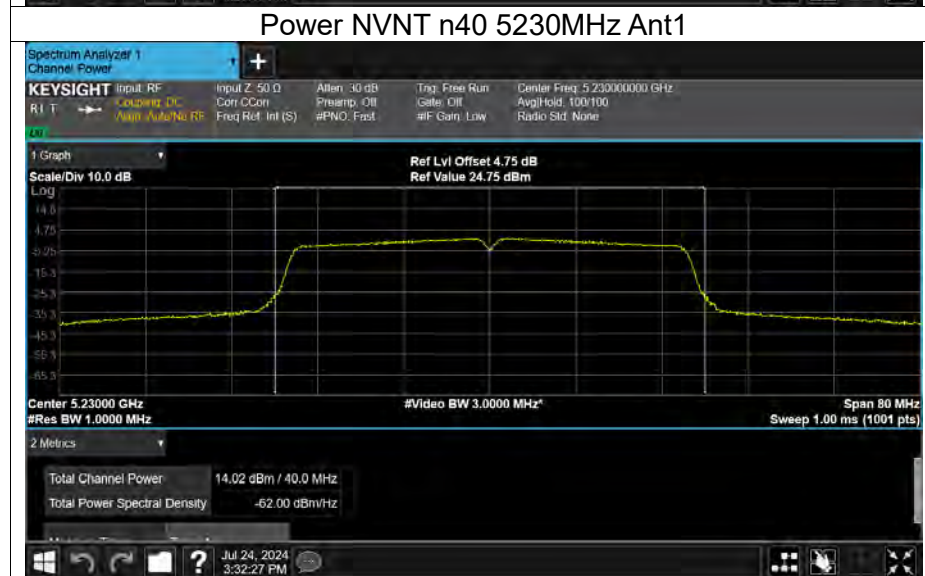
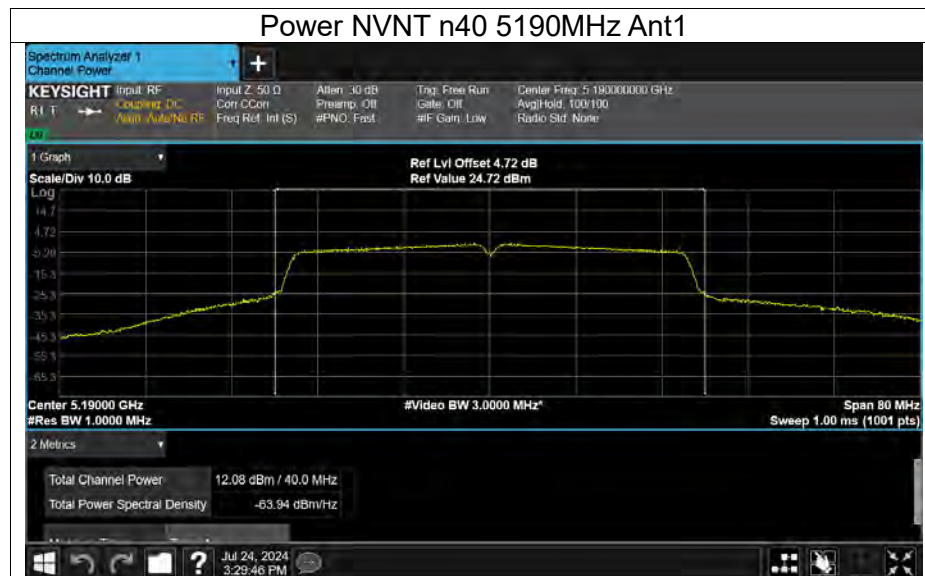


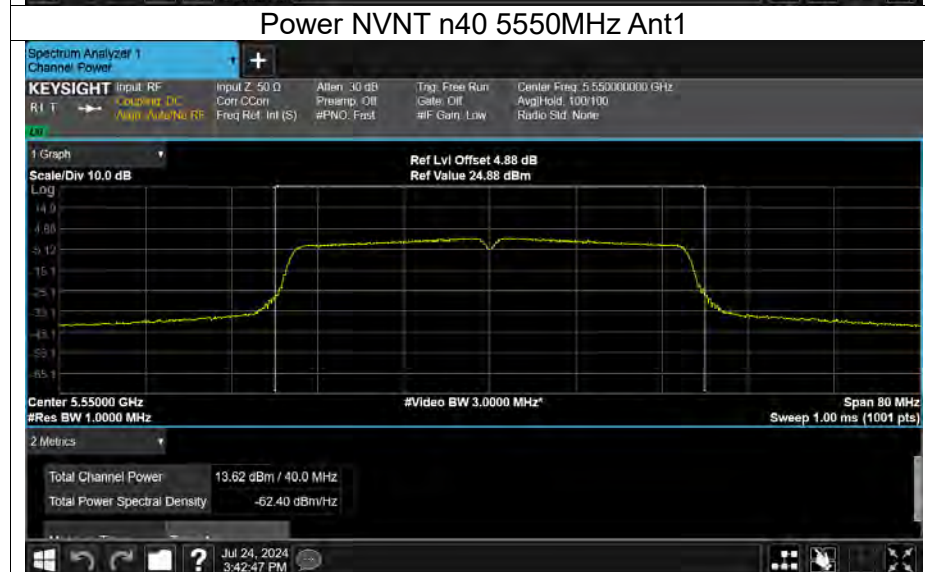
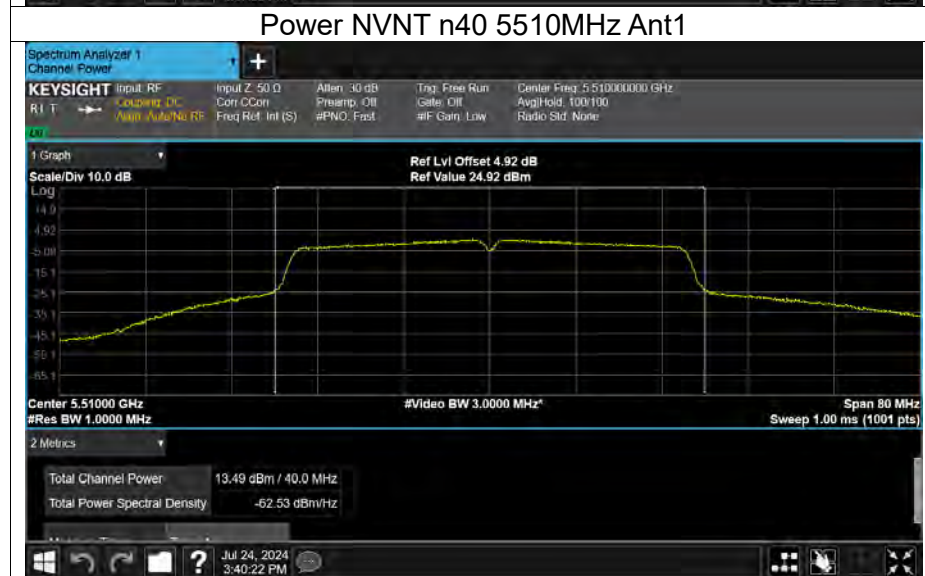
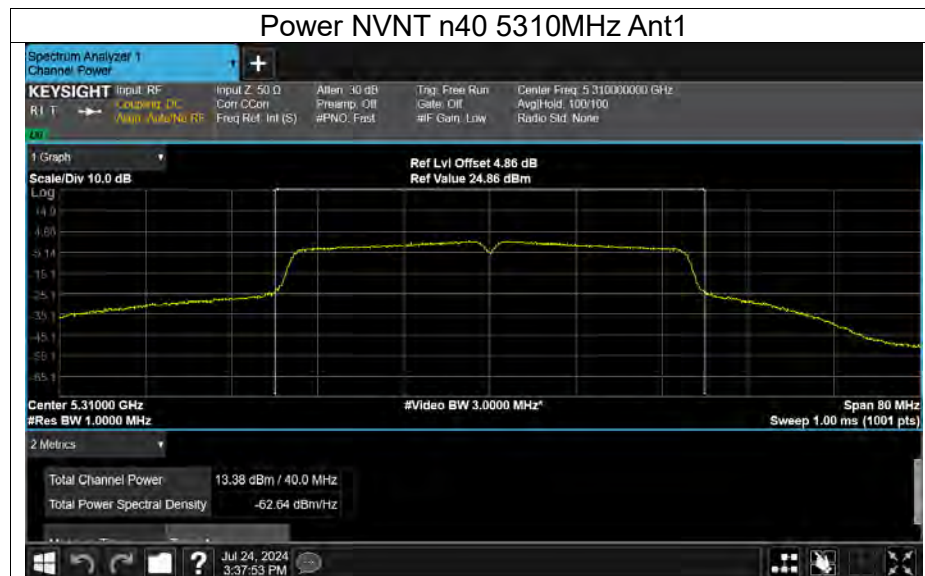


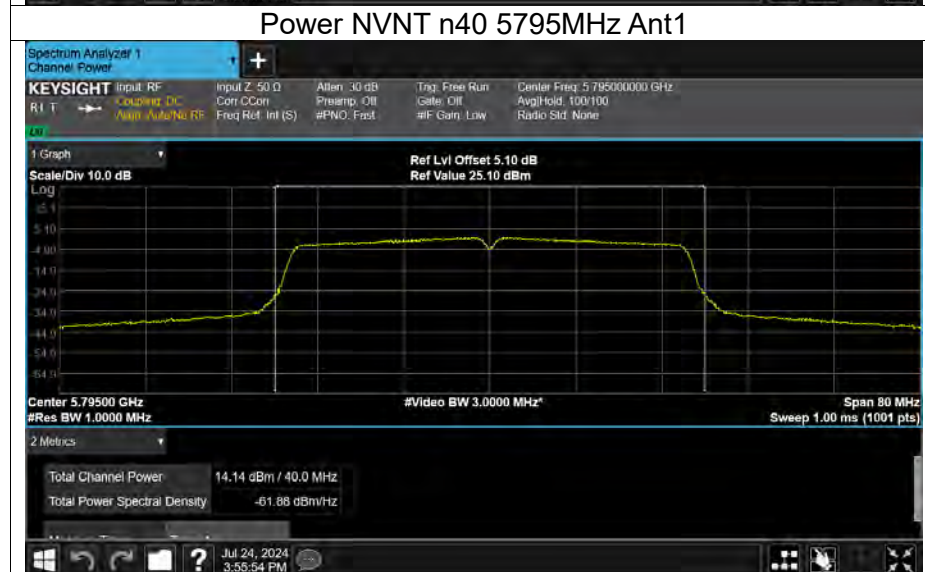
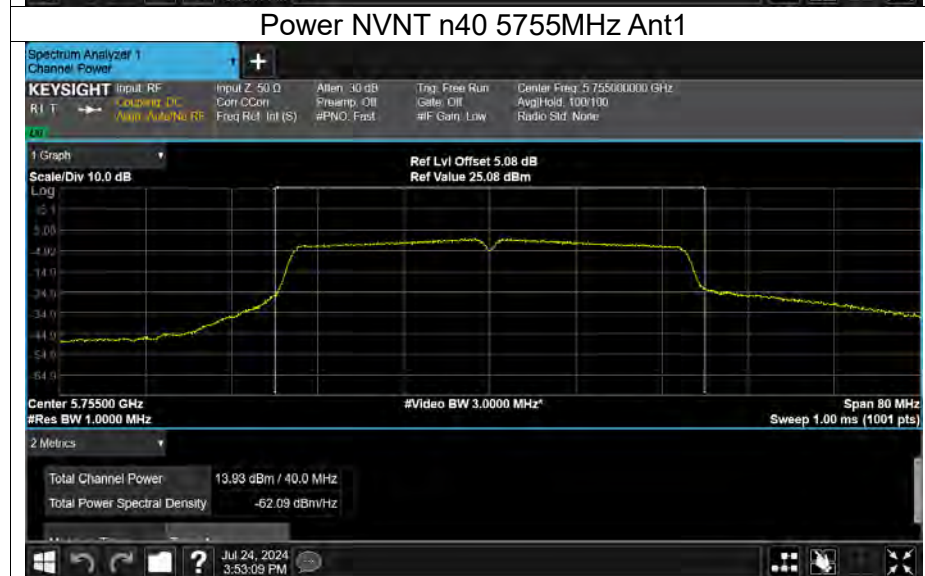
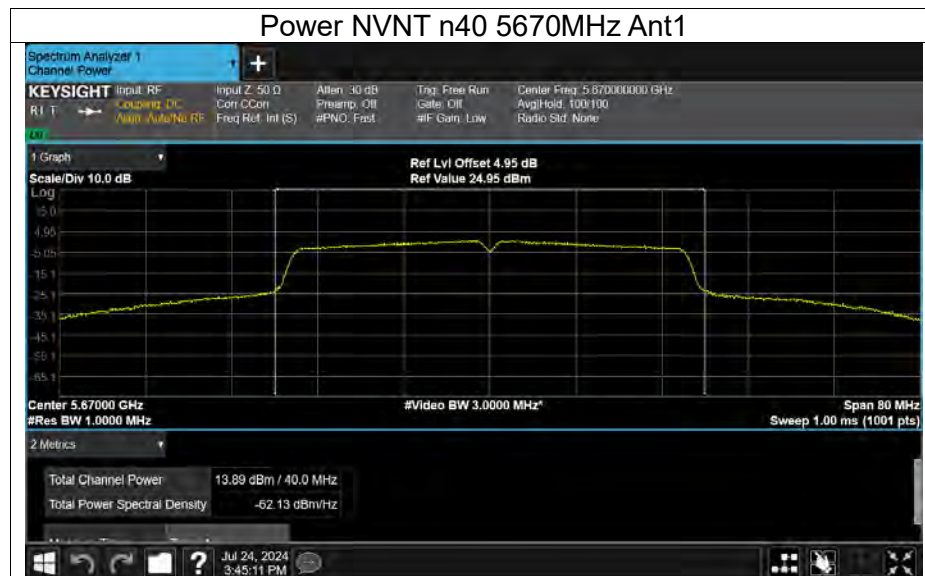


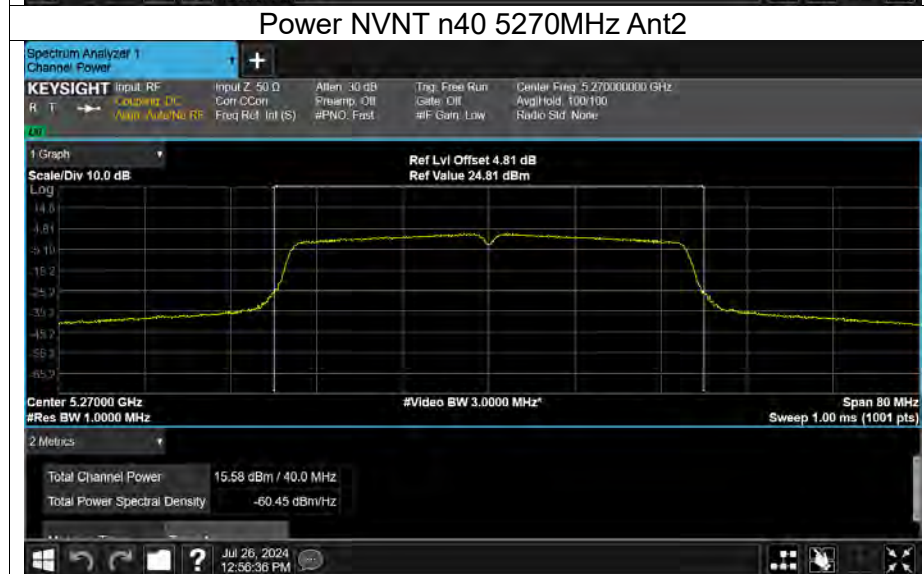
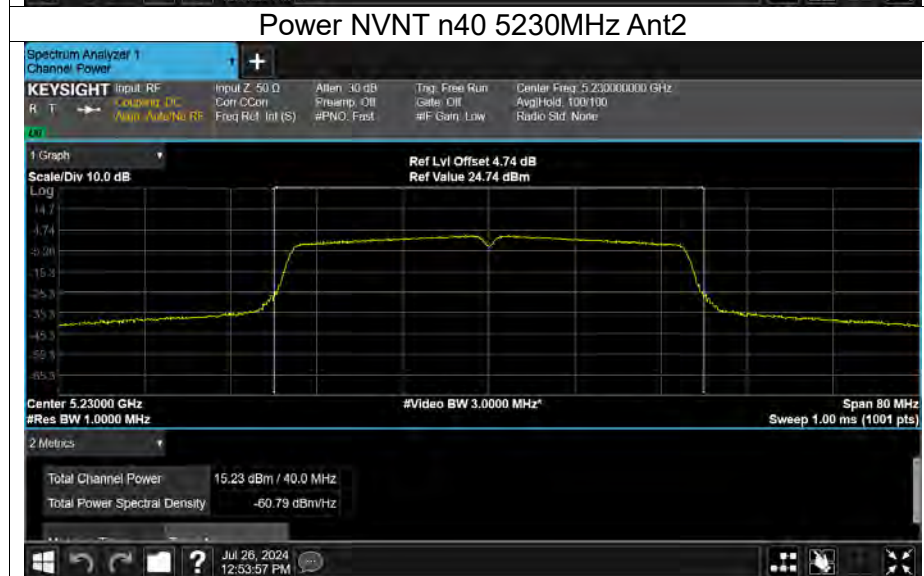
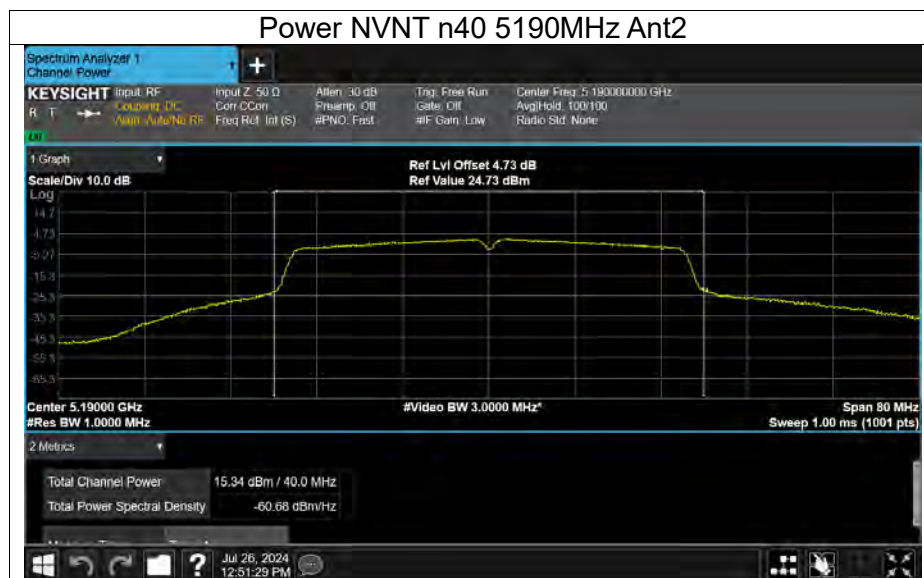


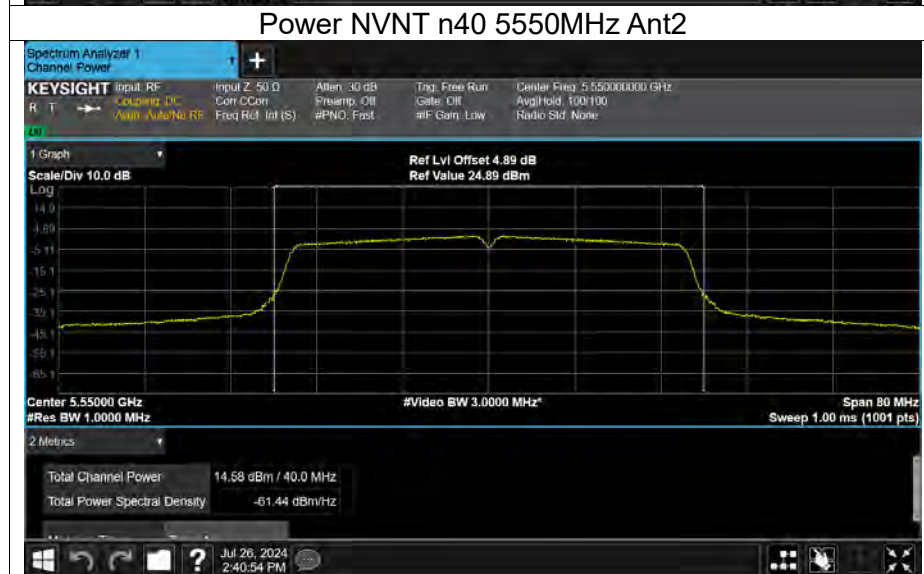
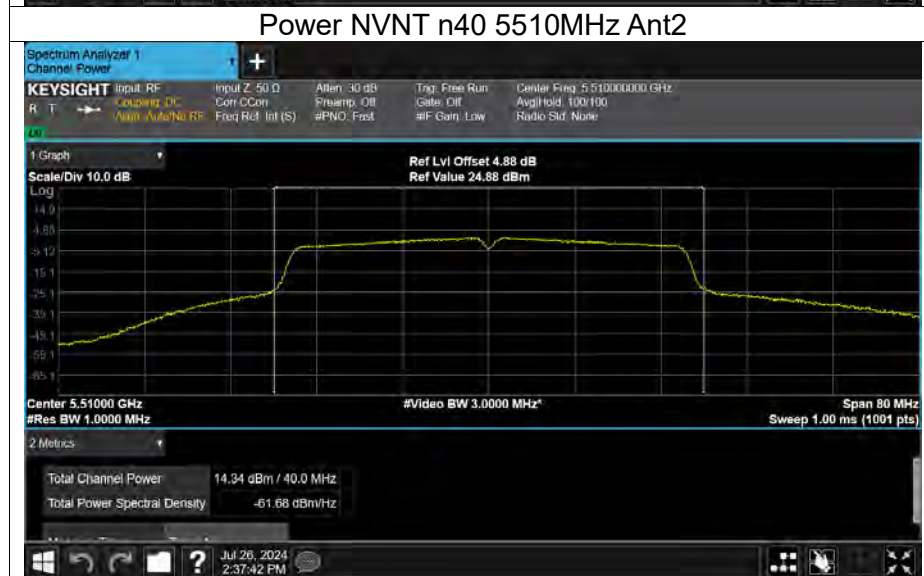
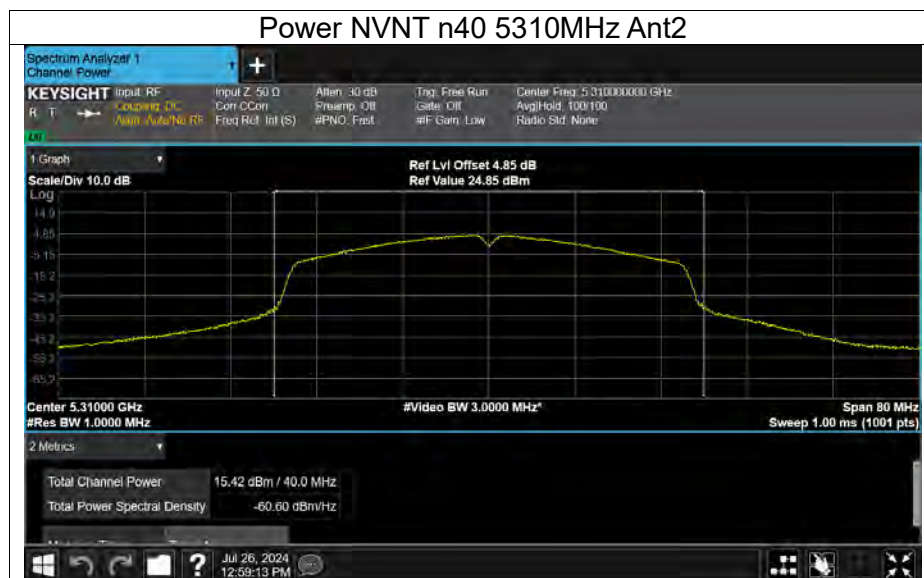


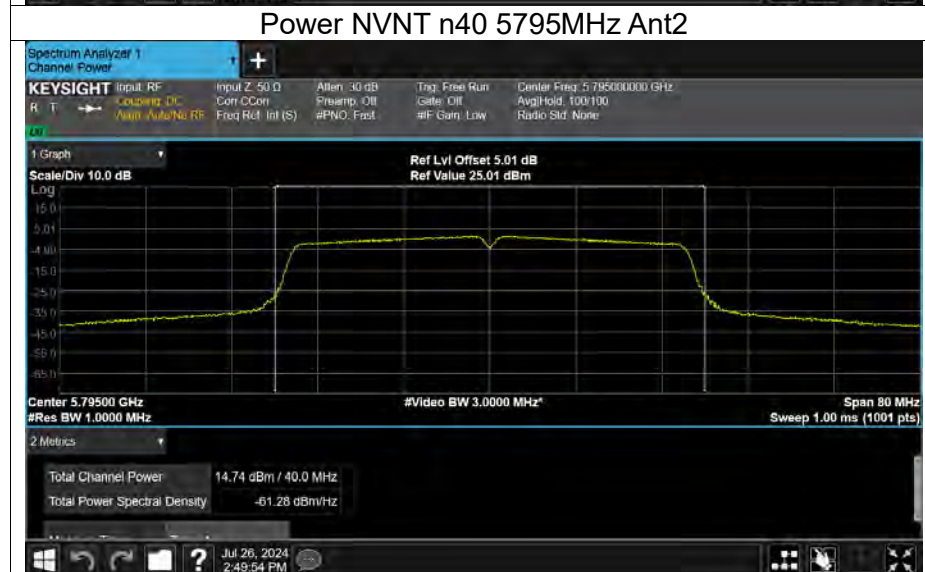
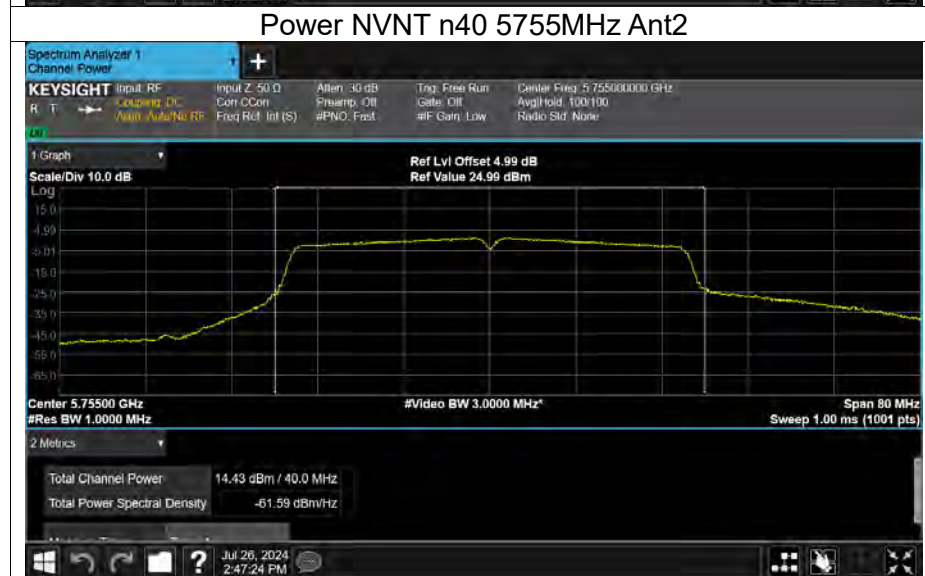
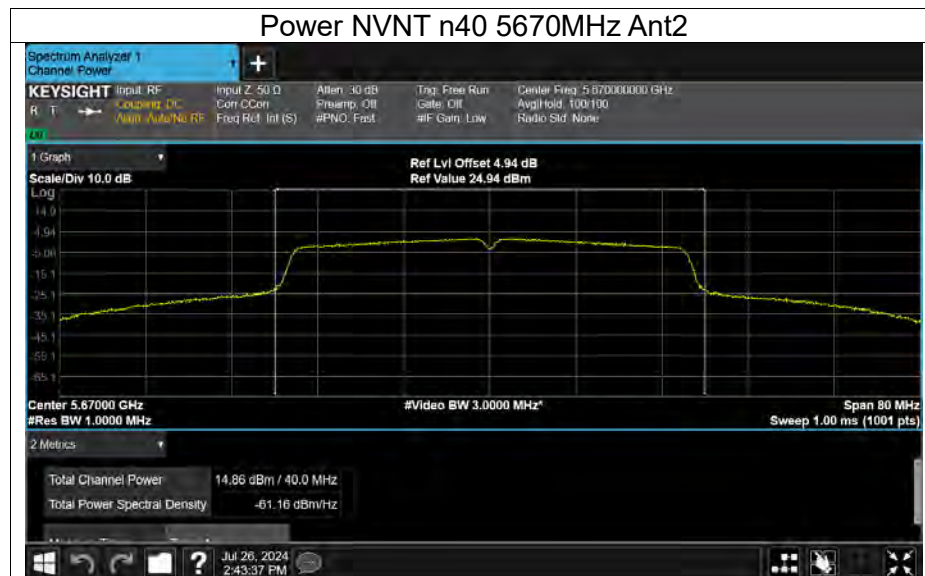


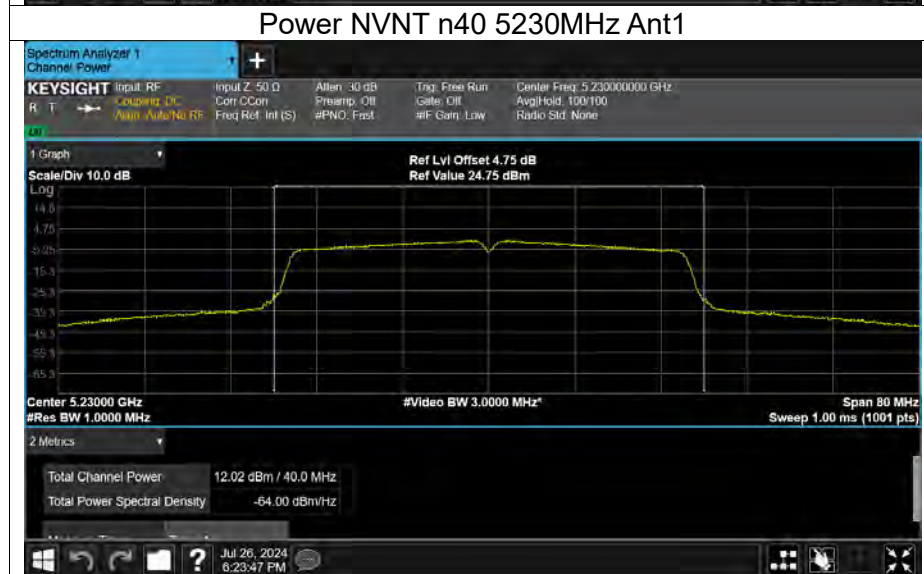
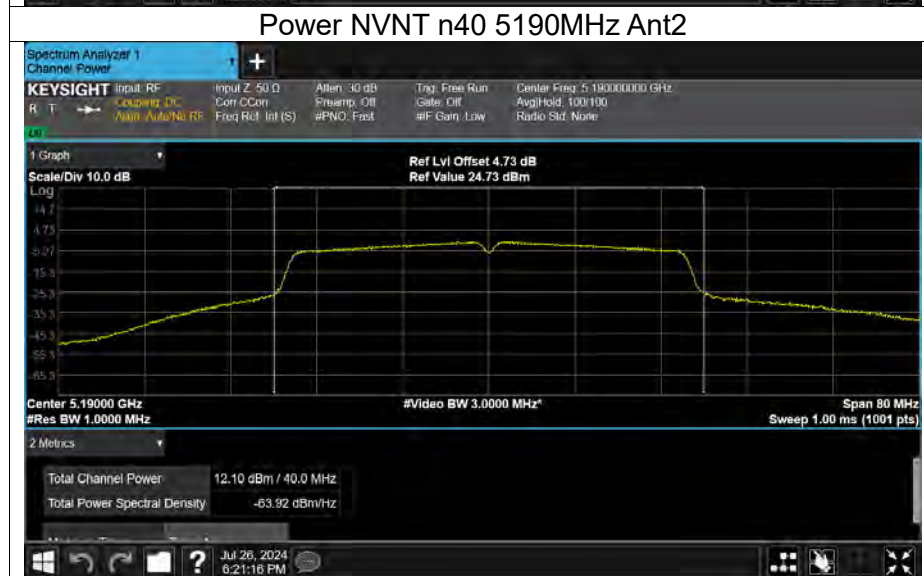
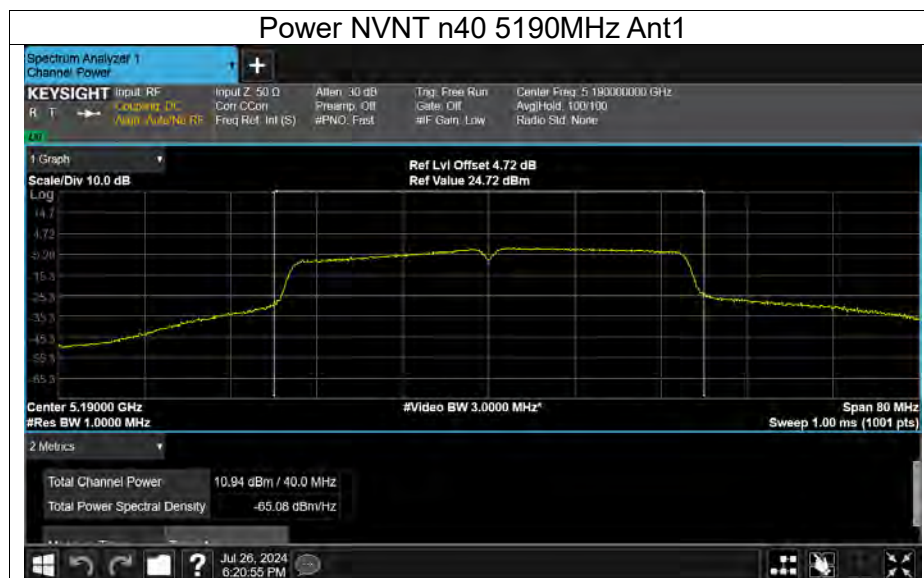


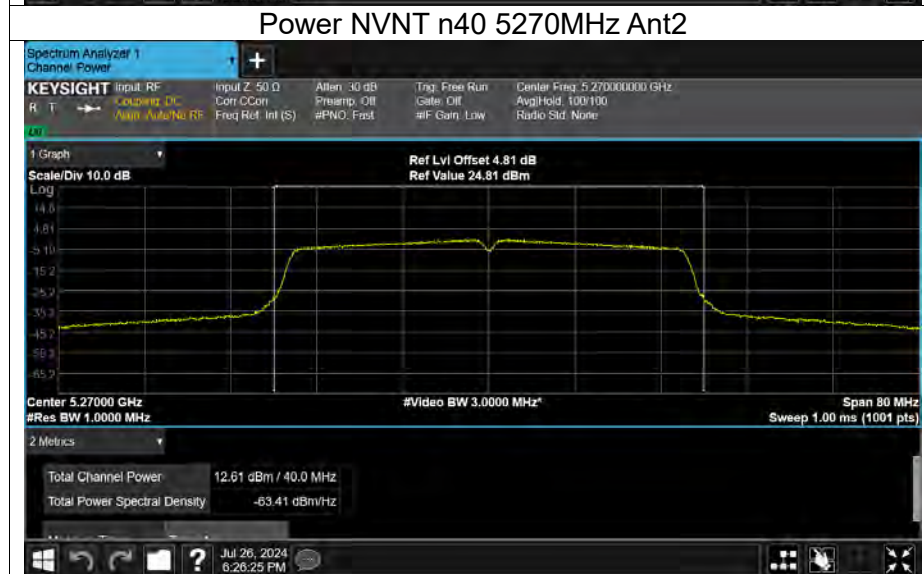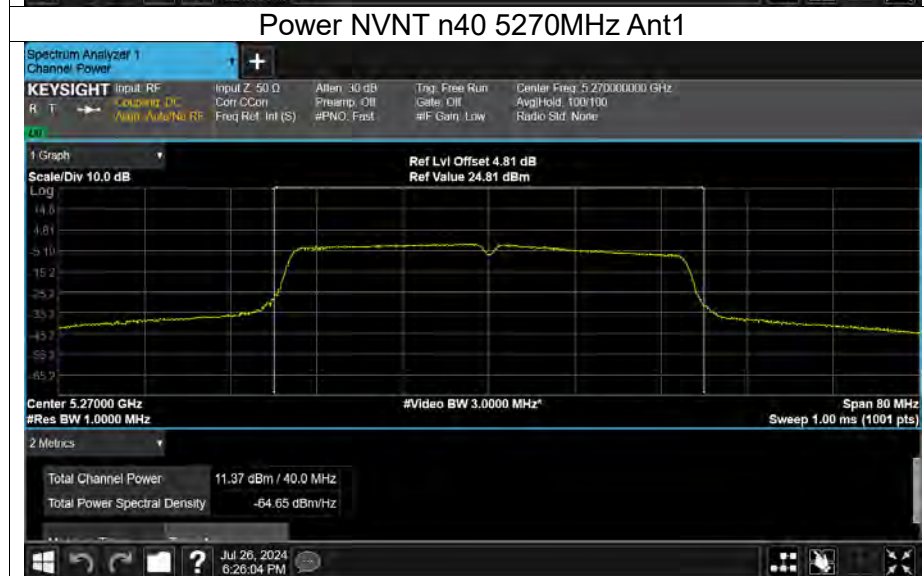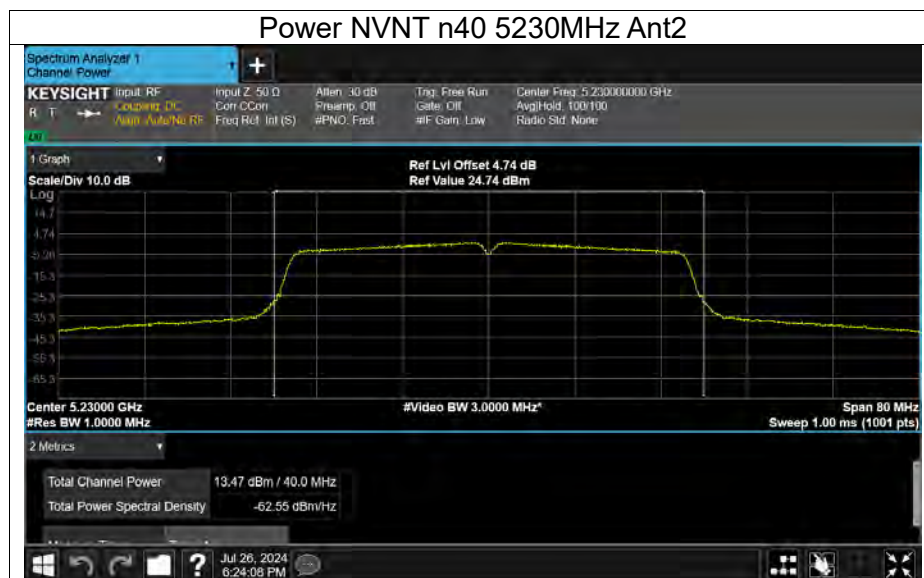

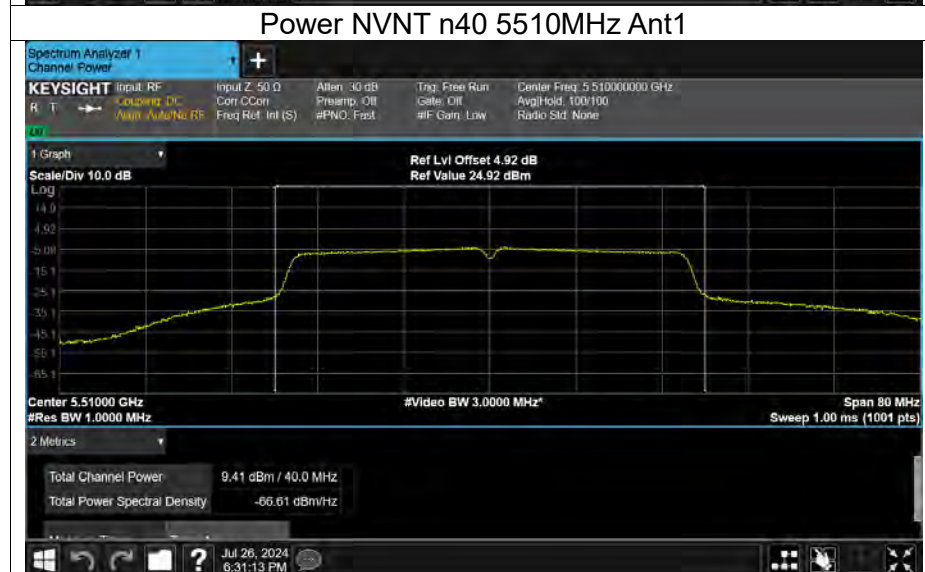
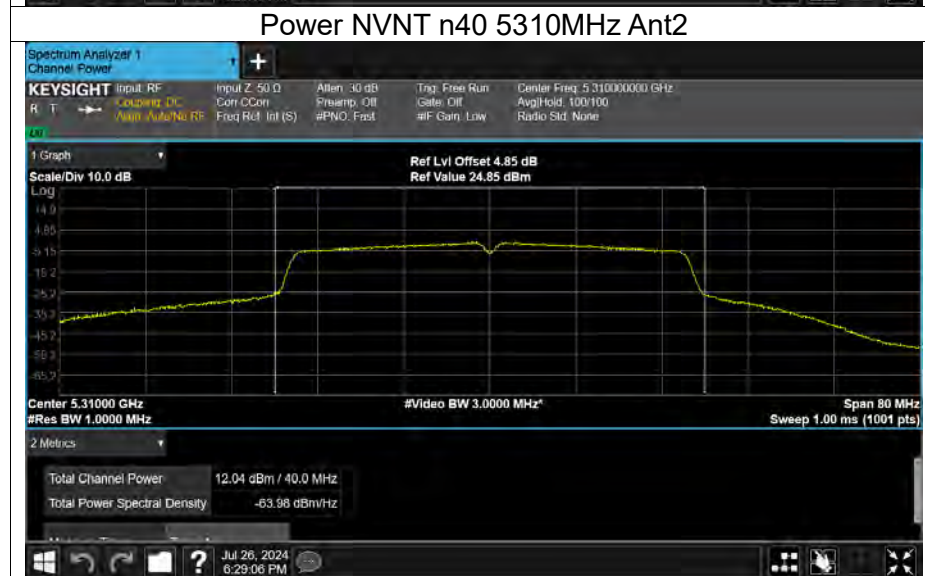
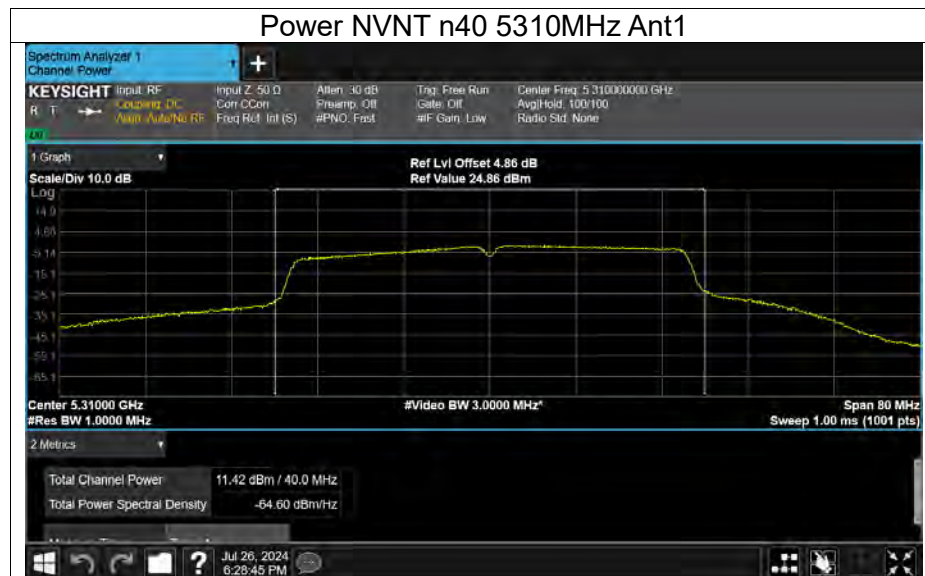


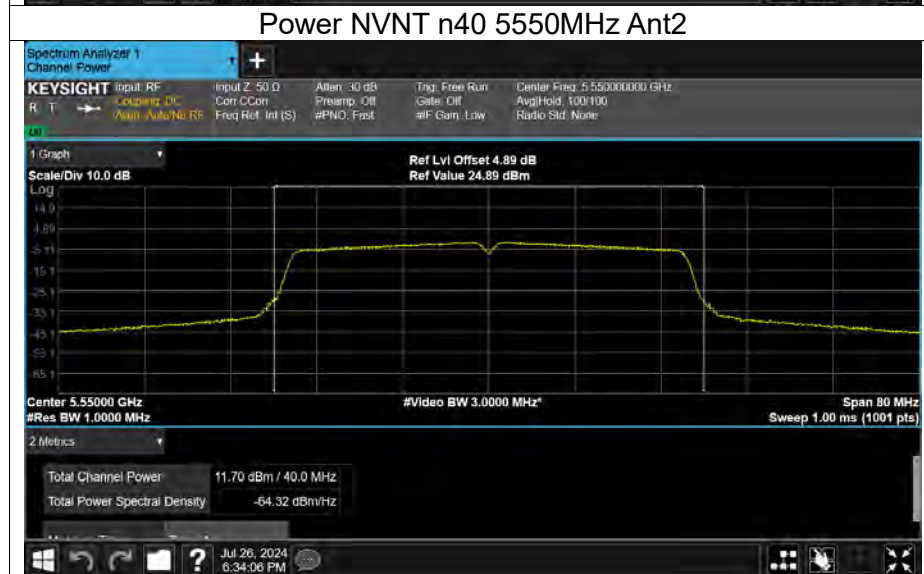
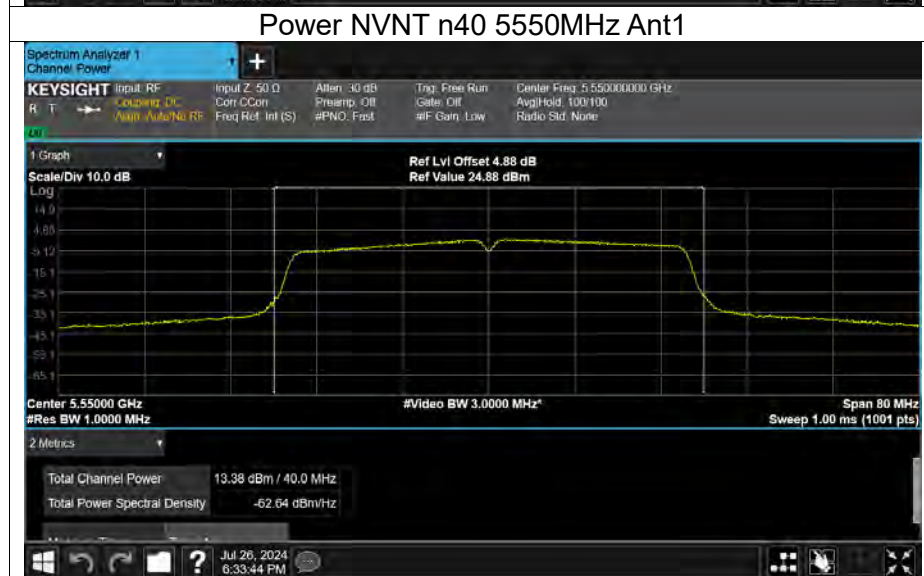
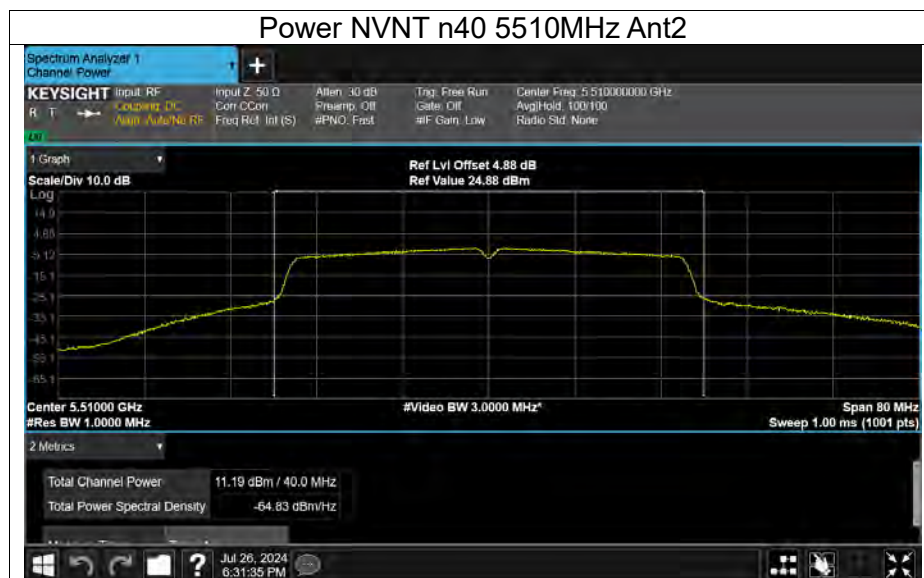


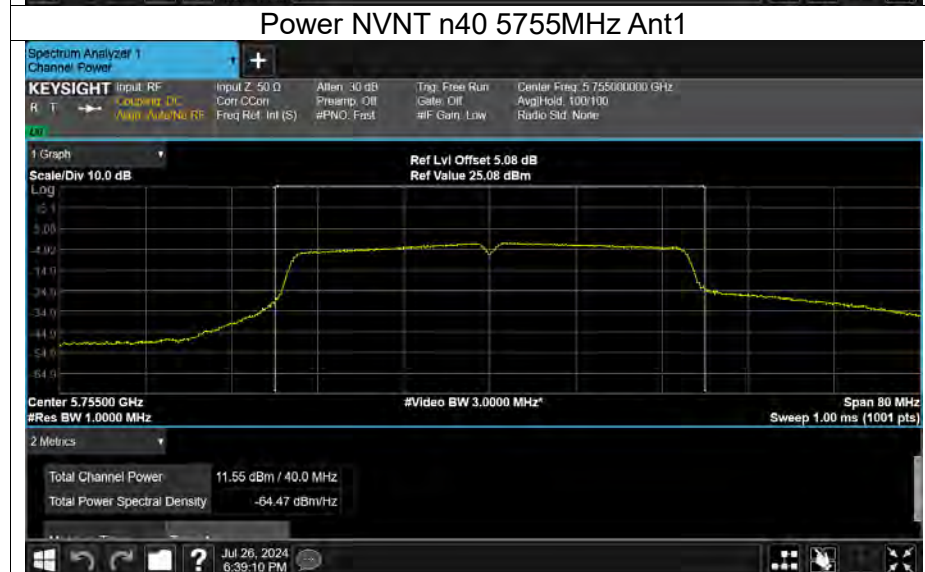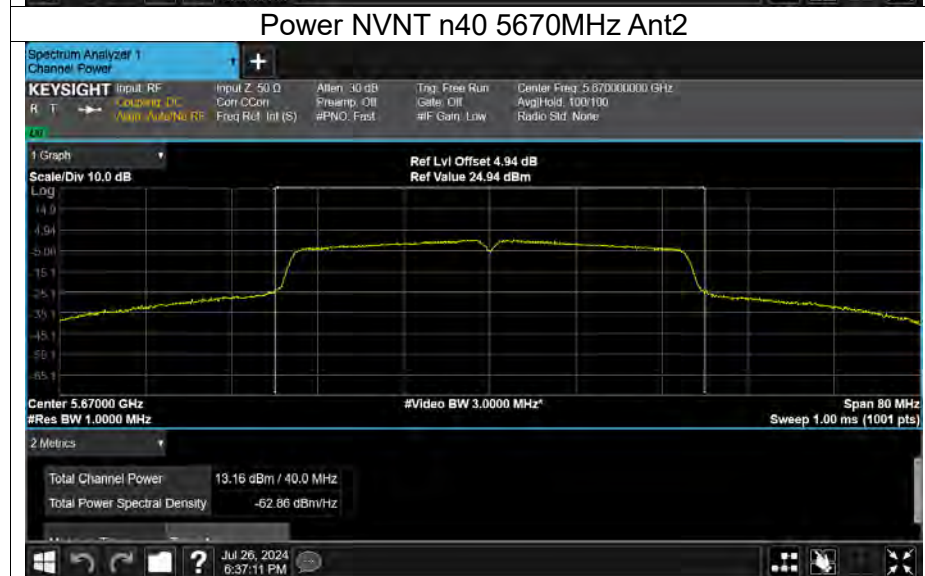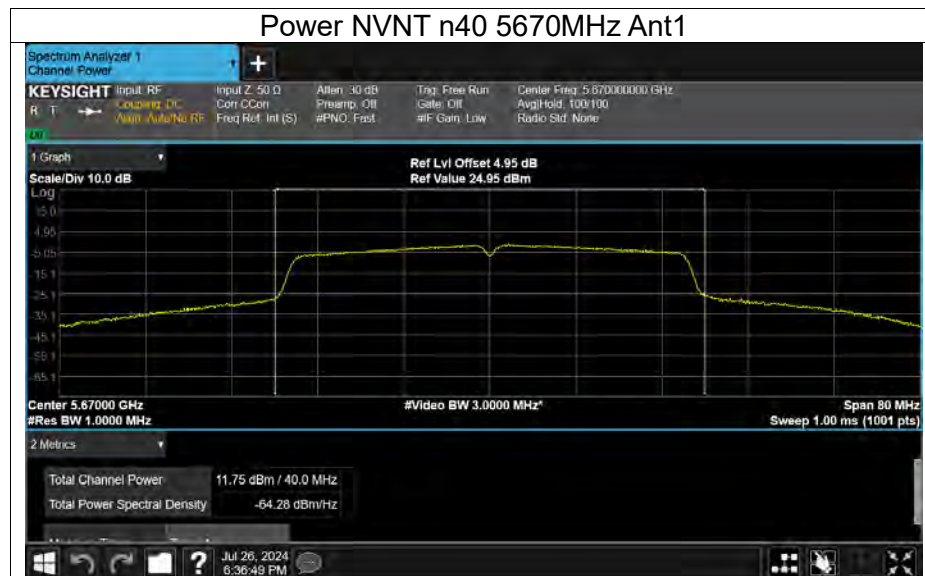

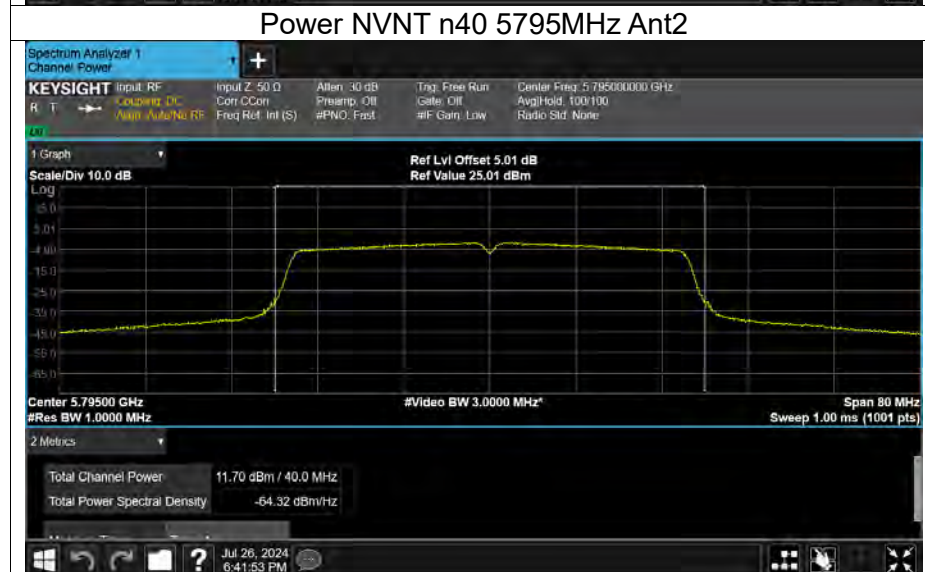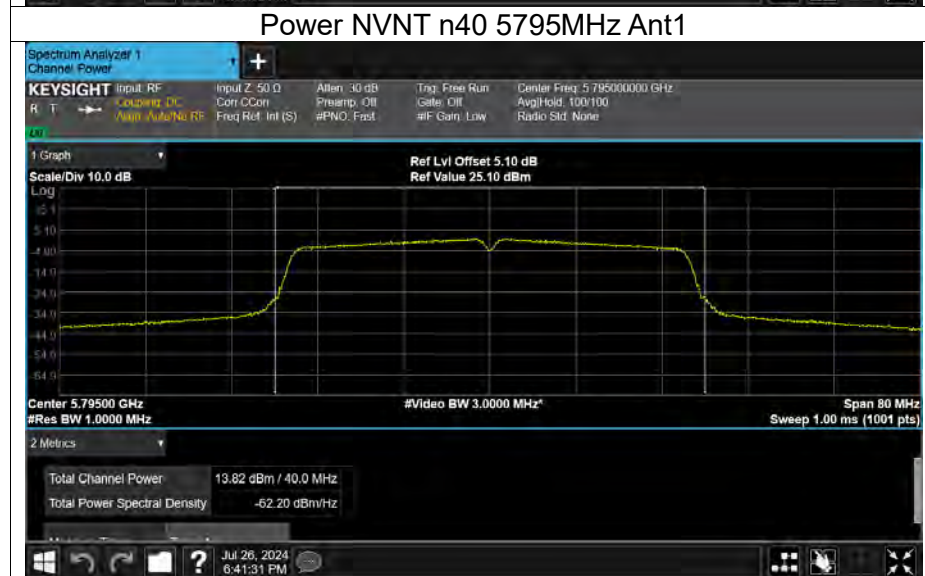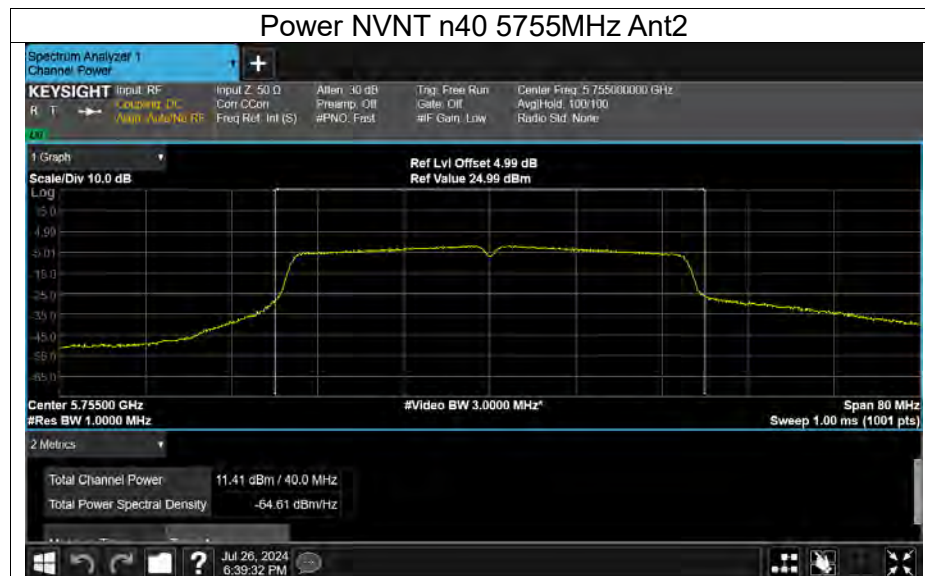



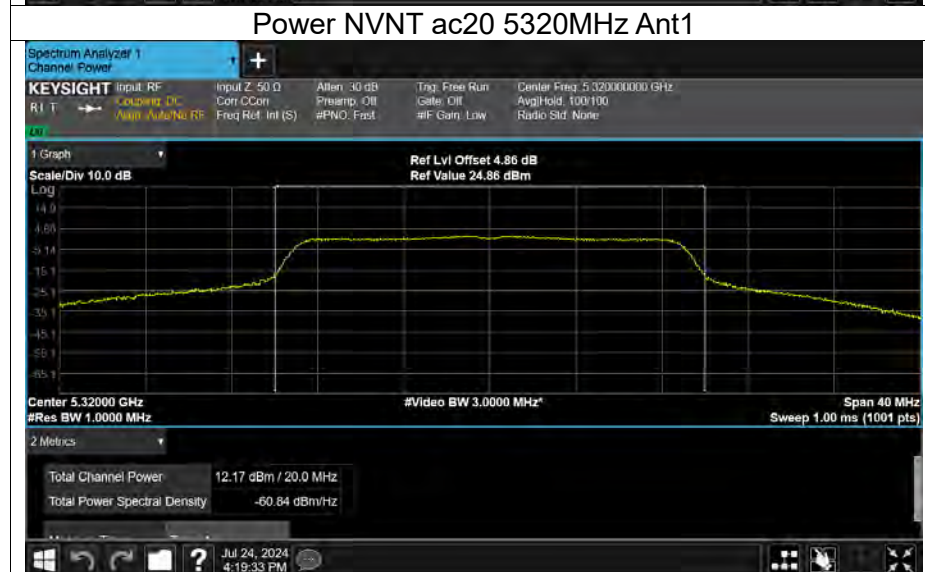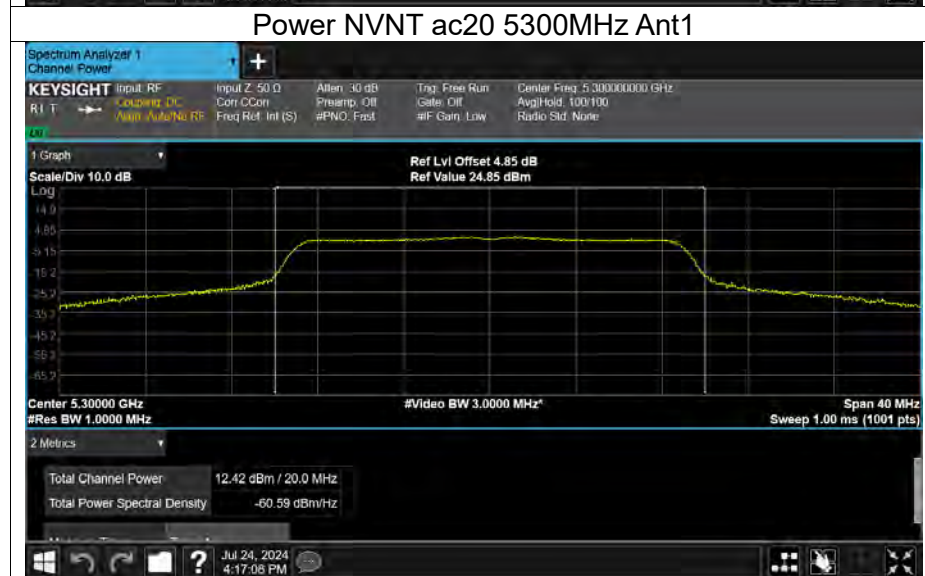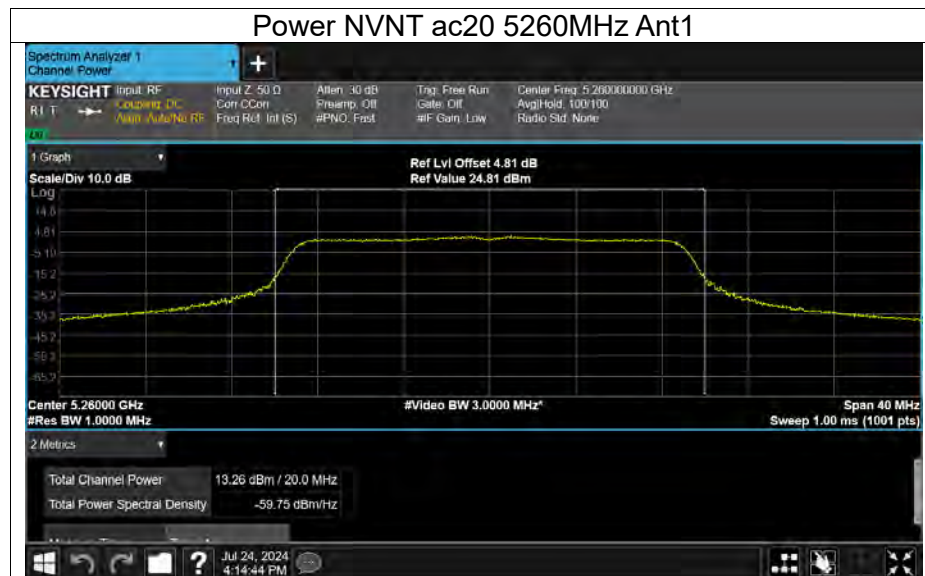


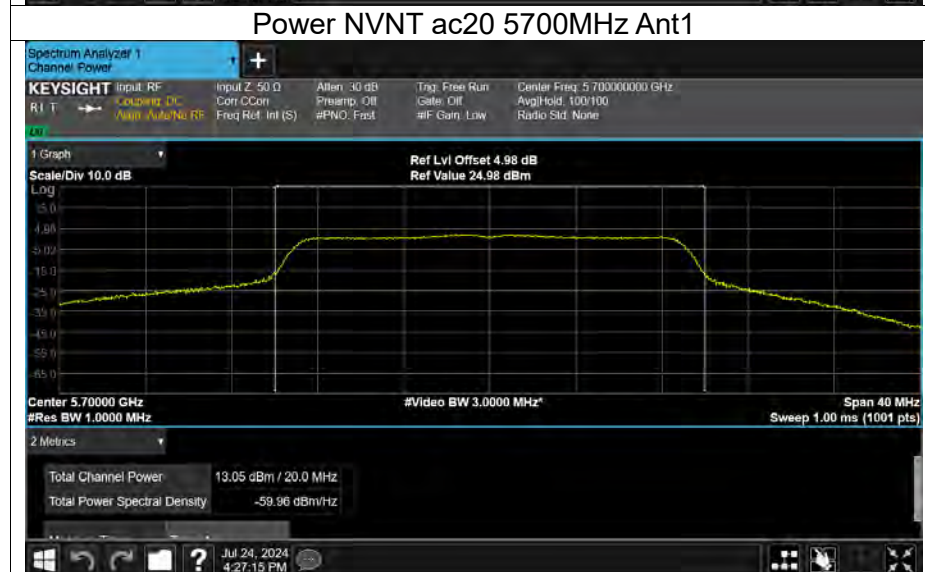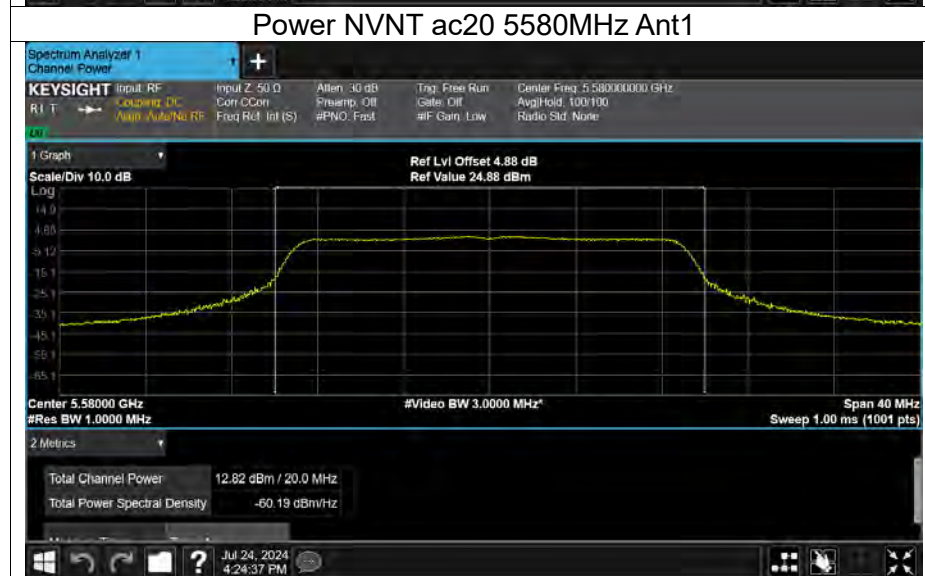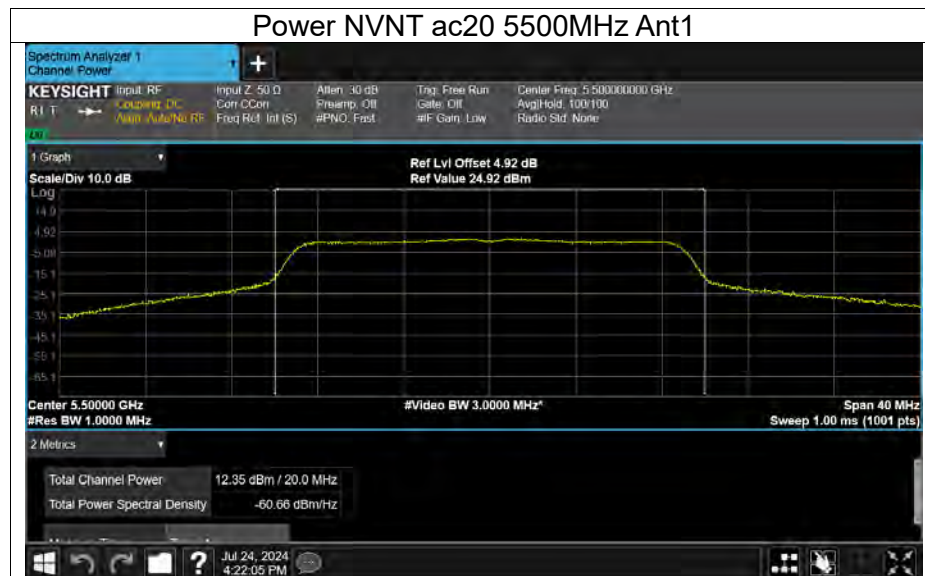






Power NVNT ac20 5180MHz Ant2



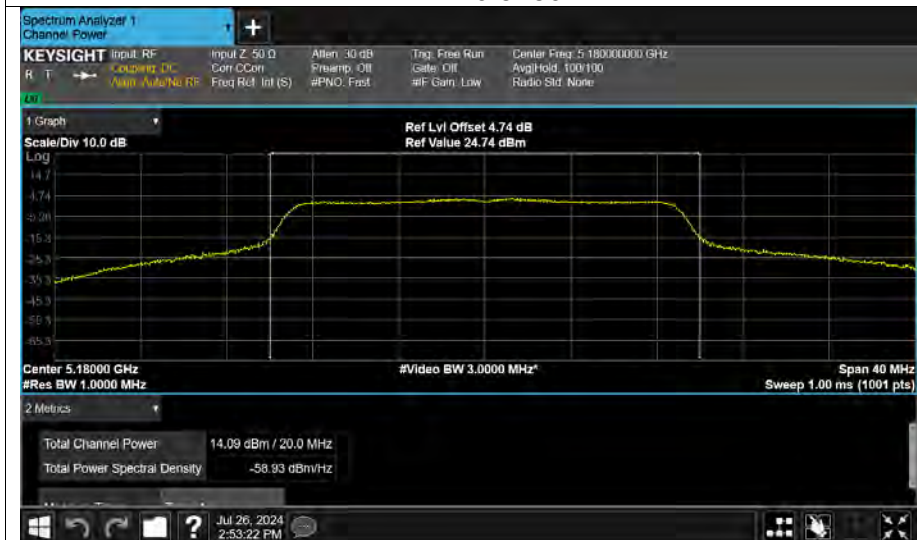


Power NVNT ac20 5200MHz Ant2

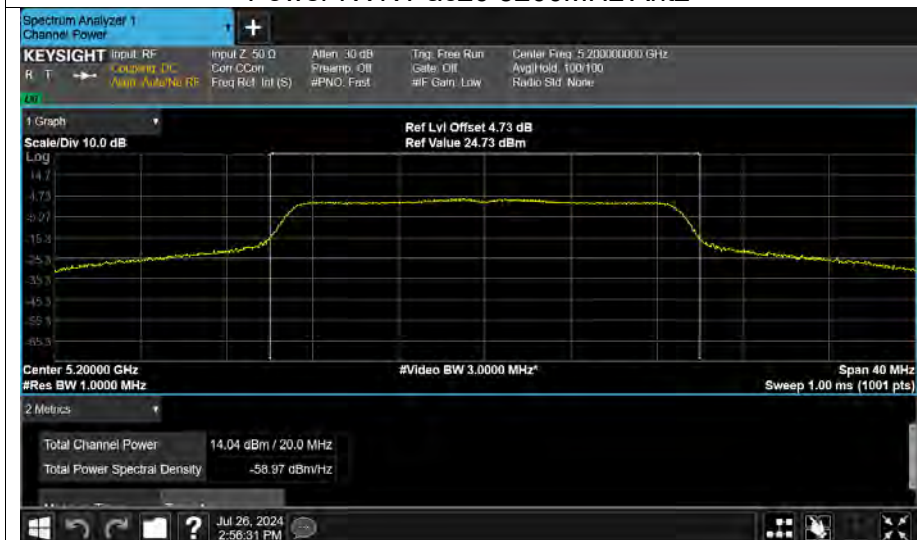

Power NVNT ac20 5240MHz Ant2



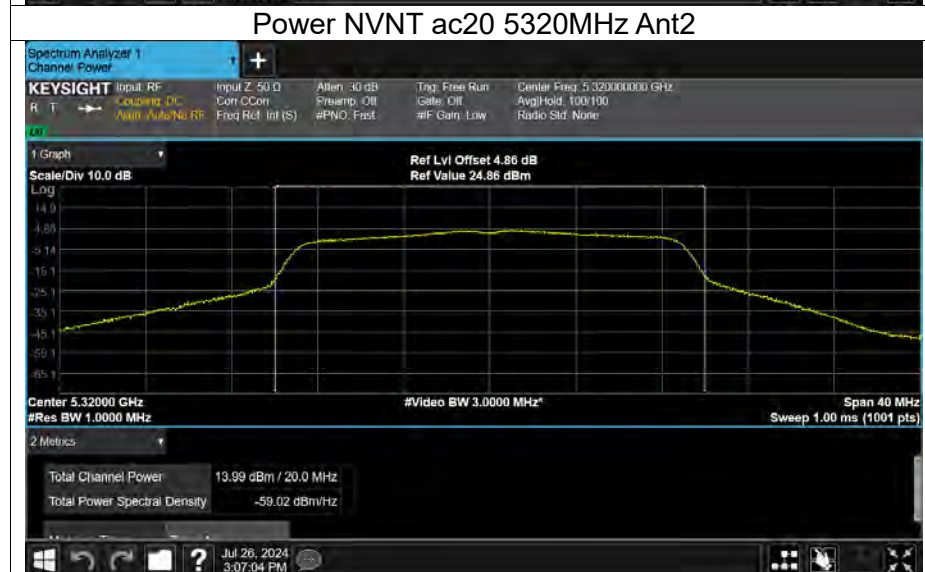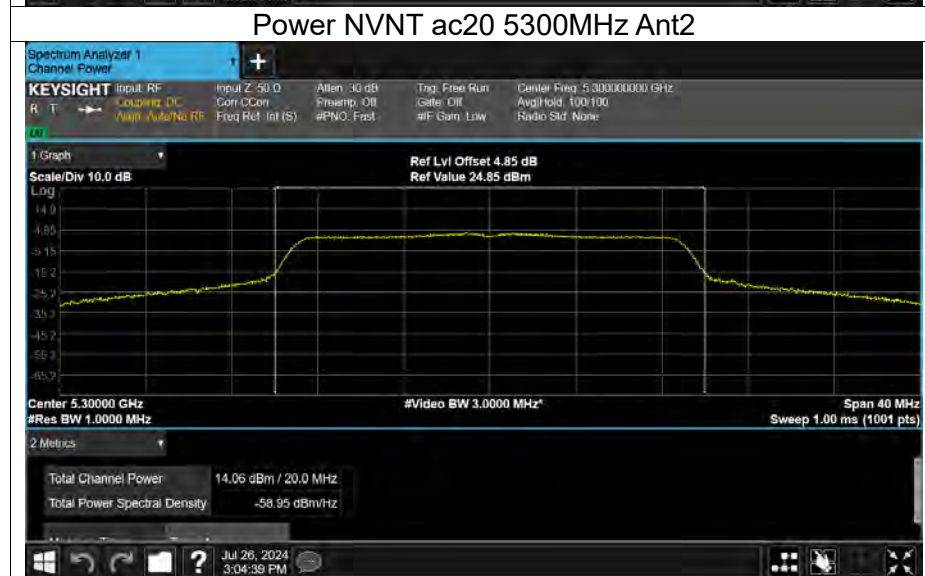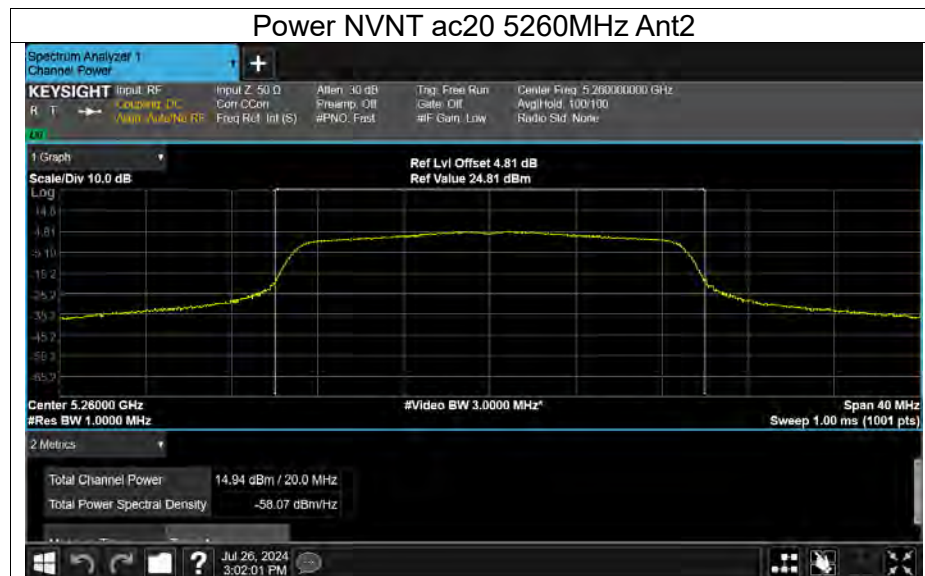





Power NVNT ac20 5500MHz Ant2






Power NVNT ac20 5580MHz Ant2

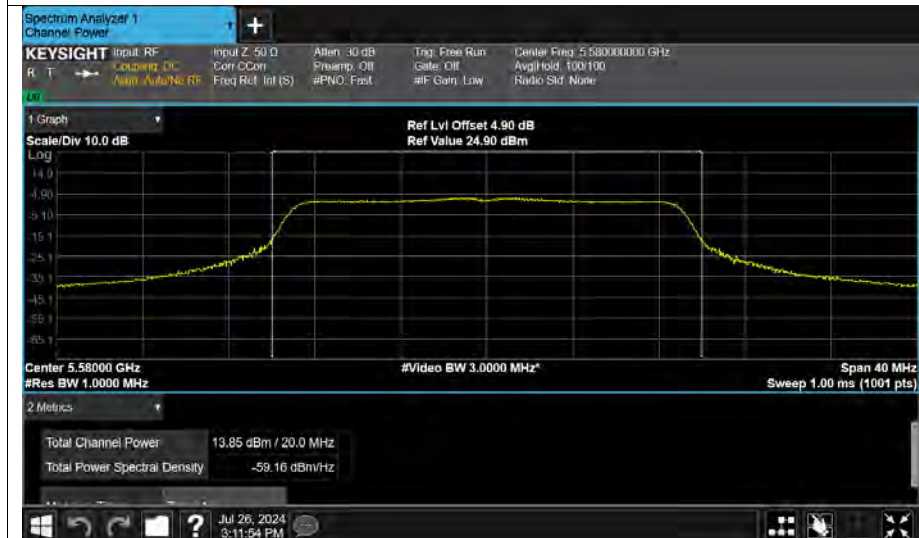


Power NVNT ac20 5700MHz Ant2

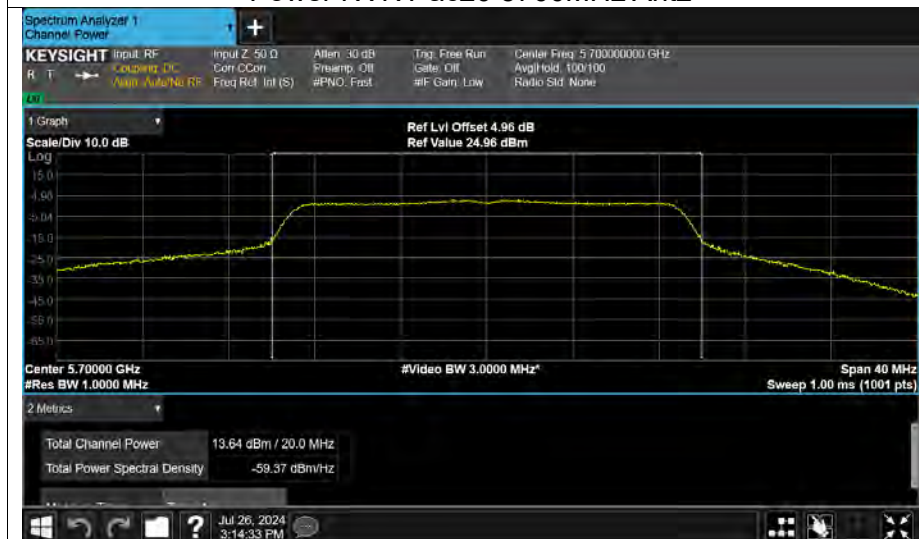

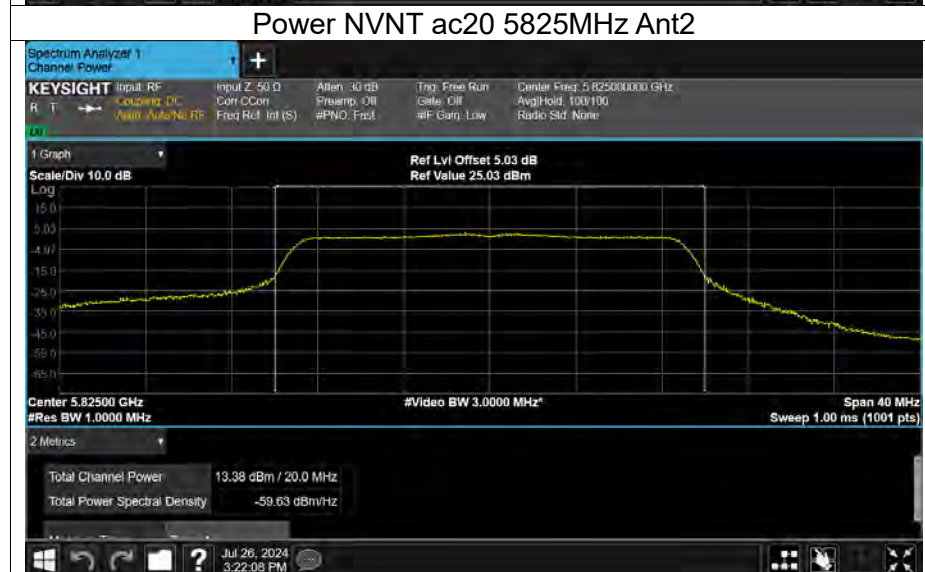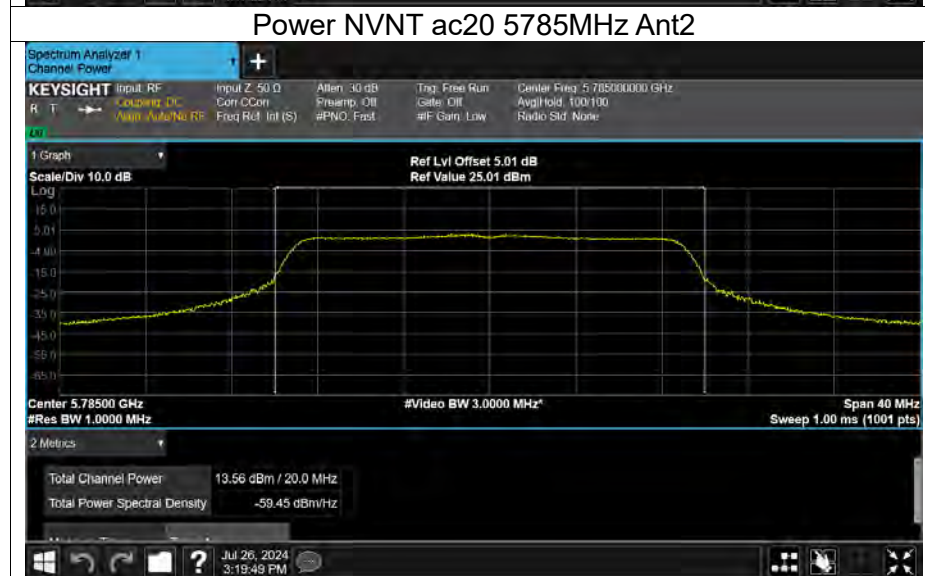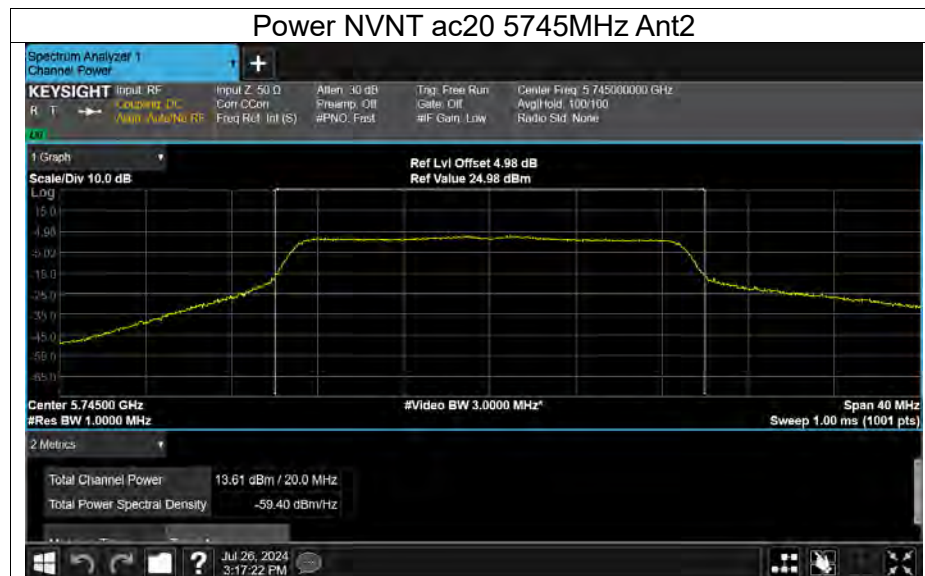





Power NVNT ac20 5180MHz Ant1

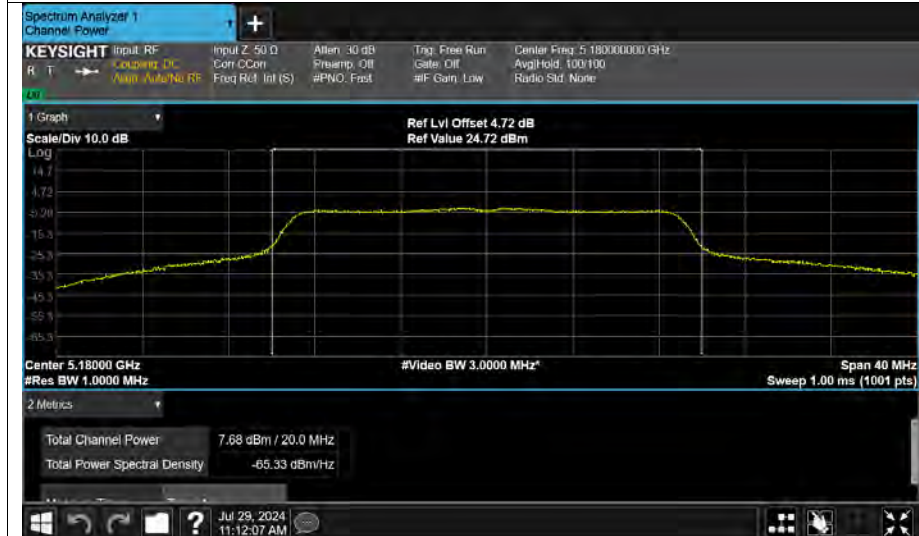

Power NVNT ac20 5180MHz Ant2

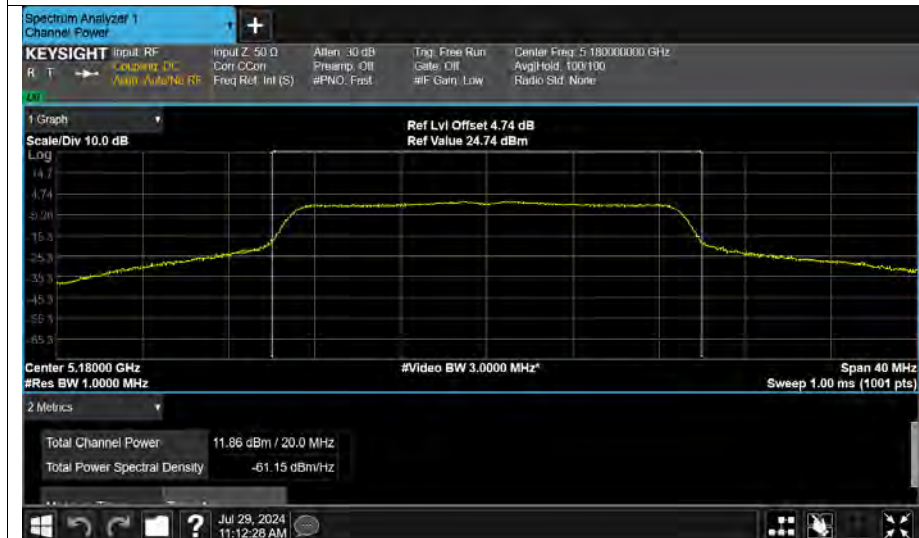


Power NVNT ac20 5200MHz Ant1

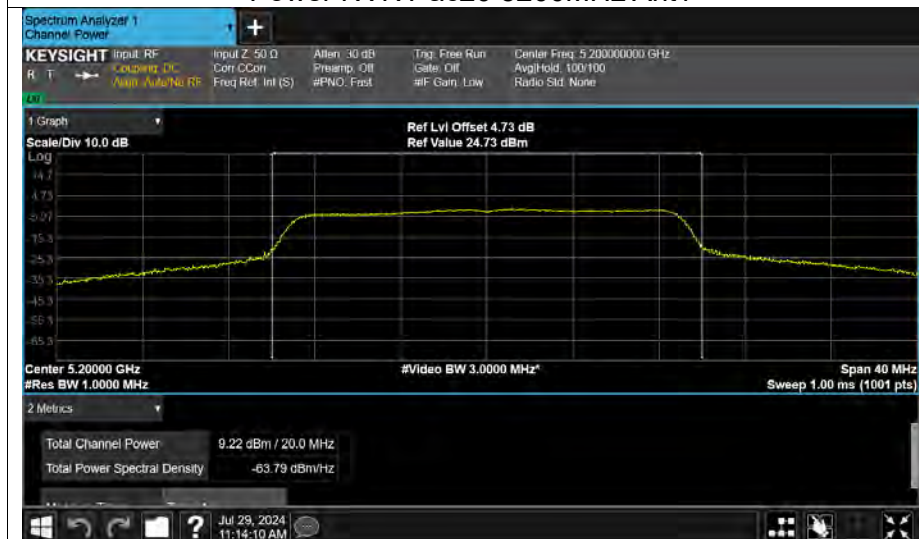





Power NVNT ac20 5200MHz Ant2

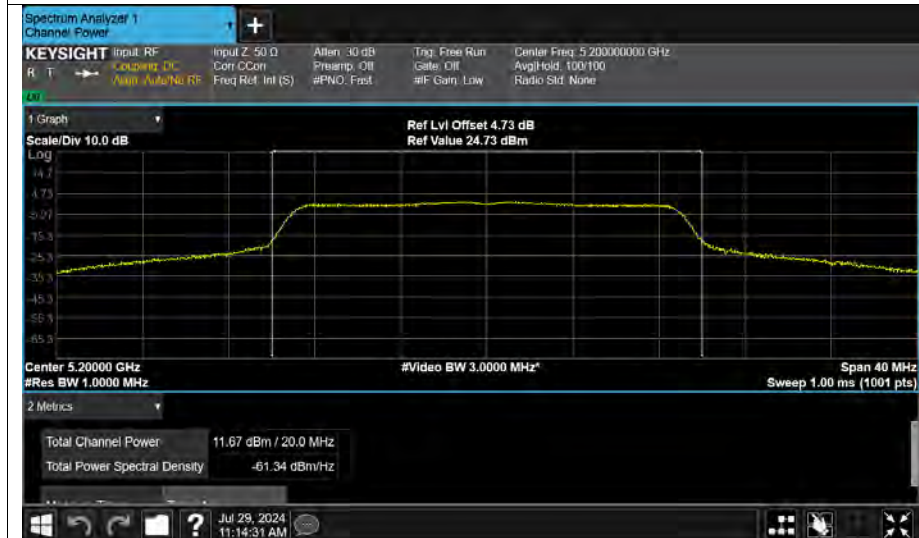

Power NVNT ac20 5240MHz Ant1

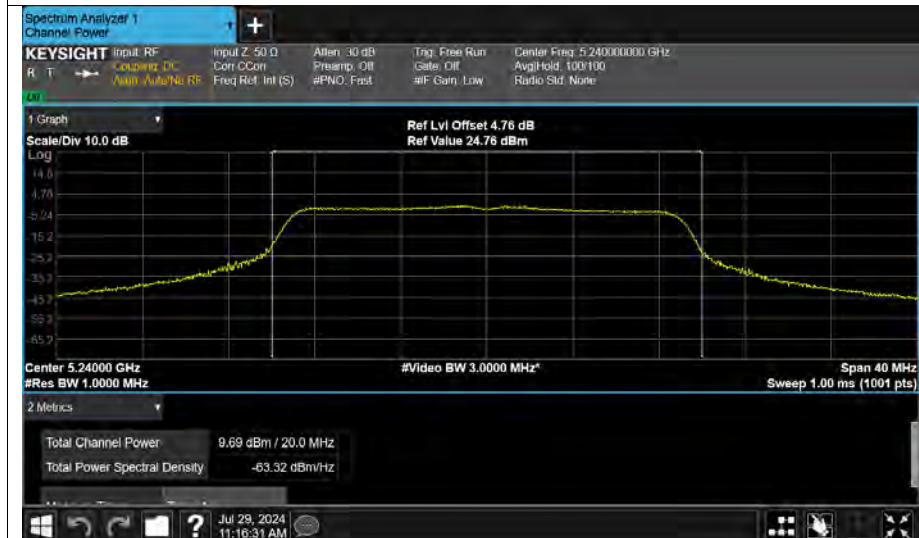


Power NVNT ac20 5240MHz Ant2

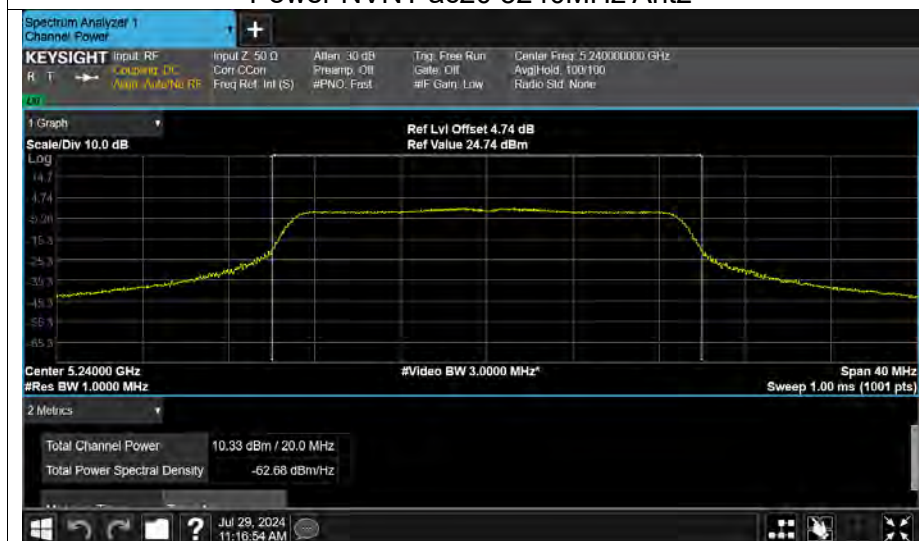




Power NVNT ac20 5260MHz Ant1

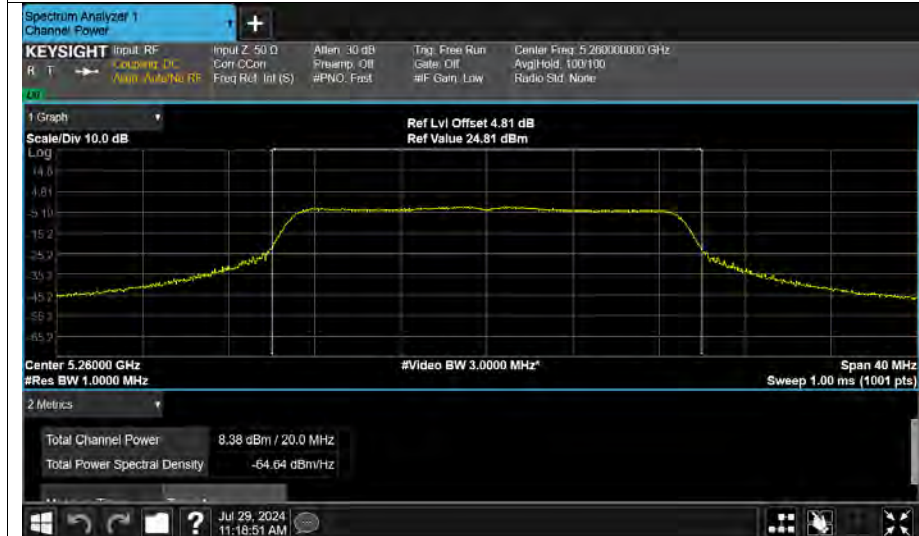

Power NVNT ac20 5260MHz Ant2

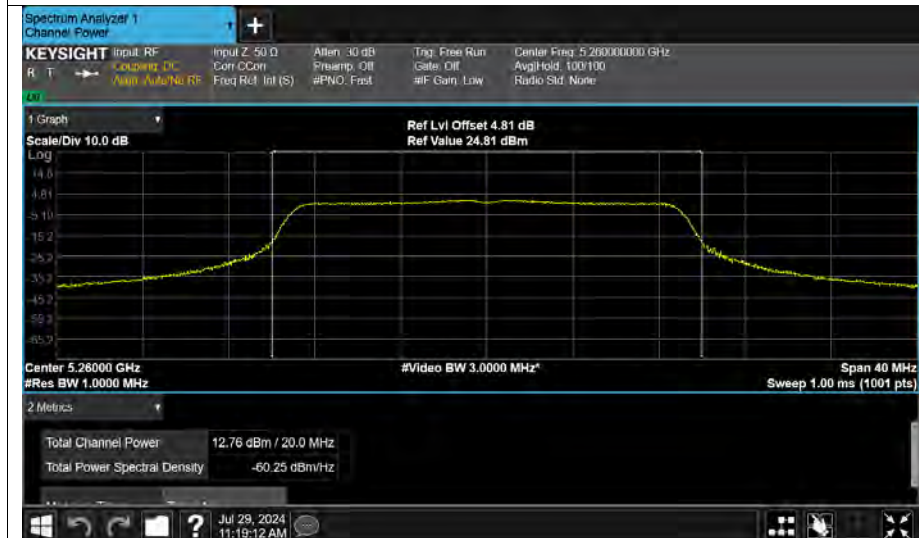

Power NVNT ac20 5300MHz Ant1

