



-26dB Bandwidth NVNT ax80 5210MHz Ant2




-26dB Bandwidth NVNT ax80 5290MHz Ant2



-26dB Bandwidth NVNT ax80 5530MHz Ant2



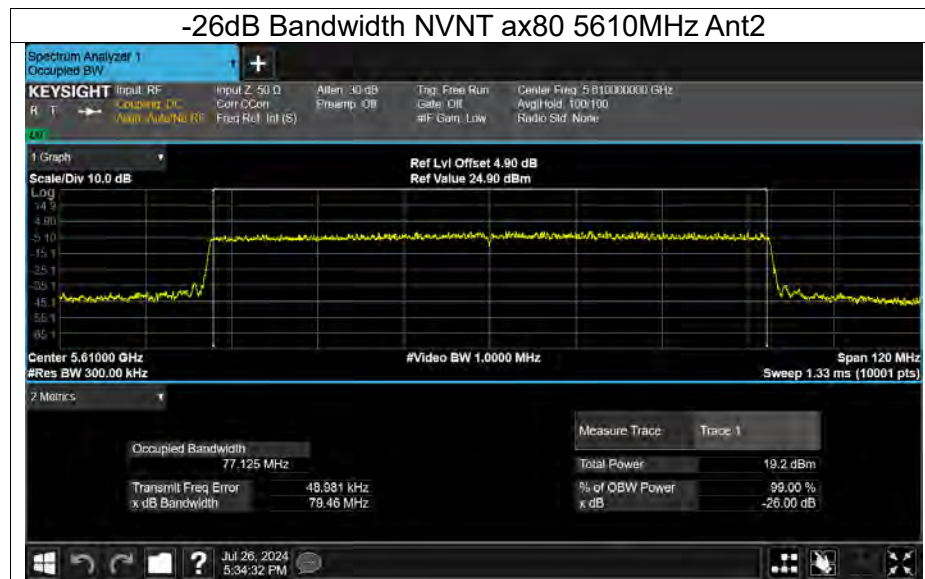



Occupied Channel Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	99% OBW (MHz)
NVNT	a	5180	Ant1	16.931
NVNT	a	5200	Ant1	16.87
NVNT	a	5240	Ant1	16.598
NVNT	a	5260	Ant1	16.587
NVNT	a	5300	Ant1	16.927
NVNT	a	5320	Ant1	16.849
NVNT	a	5500	Ant1	16.843
NVNT	a	5580	Ant1	16.598
NVNT	a	5700	Ant1	16.835
NVNT	a	5745	Ant1	16.768
NVNT	a	5785	Ant1	16.58
NVNT	a	5825	Ant1	16.607
NVNT	a	5180	Ant2	16.766
NVNT	a	5200	Ant2	17.099
NVNT	a	5240	Ant2	16.607
NVNT	a	5260	Ant2	16.59
NVNT	a	5300	Ant2	16.906
NVNT	a	5320	Ant2	16.852
NVNT	a	5500	Ant2	16.843
NVNT	a	5580	Ant2	16.585
NVNT	a	5700	Ant2	16.762
NVNT	a	5745	Ant2	16.747
NVNT	a	5785	Ant2	16.618
NVNT	a	5825	Ant2	16.585
NVNT	n20	5180	Ant1	18.048
NVNT	n20	5200	Ant1	18.052
NVNT	n20	5240	Ant1	17.814
NVNT	n20	5260	Ant1	17.831
NVNT	n20	5300	Ant1	18.056
NVNT	n20	5320	Ant1	18.031
NVNT	n20	5500	Ant1	18.072
NVNT	n20	5580	Ant1	17.809
NVNT	n20	5700	Ant1	17.982
NVNT	n20	5745	Ant1	17.989
NVNT	n20	5785	Ant1	17.795
NVNT	n20	5825	Ant1	17.817
NVNT	n20	5180	Ant2	19.048
NVNT	n20	5200	Ant2	18.051
NVNT	n20	5240	Ant2	17.845
NVNT	n20	5260	Ant2	17.799
NVNT	n20	5300	Ant2	17.983
NVNT	n20	5320	Ant2	17.997
NVNT	n20	5500	Ant2	17.523
NVNT	n20	5580	Ant2	17.777
NVNT	n20	5700	Ant2	17.956
NVNT	n20	5745	Ant2	17.942
NVNT	n20	5785	Ant2	17.781
NVNT	n20	5825	Ant2	17.794
NVNT	n40	5190	Ant1	36.25
NVNT	n40	5230	Ant1	36.076
NVNT	n40	5270	Ant1	36.104
NVNT	n40	5310	Ant1	36.223
NVNT	n40	5510	Ant1	36.279



NVNT	n40	5550	Ant1	36.138
NVNT	n40	5670	Ant1	36.287
NVNT	n40	5755	Ant1	36.234
NVNT	n40	5795	Ant1	36.034
NVNT	n40	5190	Ant2	36.123
NVNT	n40	5230	Ant2	35.999
NVNT	n40	5270	Ant2	36.033
NVNT	n40	5310	Ant2	33.691
NVNT	n40	5510	Ant2	36.171
NVNT	n40	5550	Ant2	36.013
NVNT	n40	5670	Ant2	36.159
NVNT	n40	5755	Ant2	36.176
NVNT	n40	5795	Ant2	36.071
NVNT	ac20	5180	Ant1	18.022
NVNT	ac20	5200	Ant1	18.01
NVNT	ac20	5240	Ant1	17.818
NVNT	ac20	5260	Ant1	17.817
NVNT	ac20	5300	Ant1	18.035
NVNT	ac20	5320	Ant1	18.028
NVNT	ac20	5500	Ant1	18.029
NVNT	ac20	5580	Ant1	17.826
NVNT	ac20	5700	Ant1	18.012
NVNT	ac20	5745	Ant1	17.986
NVNT	ac20	5785	Ant1	17.842
NVNT	ac20	5825	Ant1	17.833
NVNT	ac20	5180	Ant2	18.034
NVNT	ac20	5200	Ant2	18.044
NVNT	ac20	5240	Ant2	17.805
NVNT	ac20	5260	Ant2	17.51
NVNT	ac20	5300	Ant2	18.039
NVNT	ac20	5320	Ant2	17.563
NVNT	ac20	5500	Ant2	17.501
NVNT	ac20	5580	Ant2	17.778
NVNT	ac20	5700	Ant2	17.993
NVNT	ac20	5745	Ant2	17.922
NVNT	ac20	5785	Ant2	17.799
NVNT	ac20	5825	Ant2	17.824
NVNT	ac40	5190	Ant1	36.266
NVNT	ac40	5230	Ant1	36.095
NVNT	ac40	5270	Ant1	36.096
NVNT	ac40	5310	Ant1	36.271
NVNT	ac40	5510	Ant1	36.277
NVNT	ac40	5550	Ant1	36.085
NVNT	ac40	5670	Ant1	36.298
NVNT	ac40	5755	Ant1	36.247
NVNT	ac40	5795	Ant1	36.043
NVNT	ac40	5190	Ant2	36.127
NVNT	ac40	5230	Ant2	35.99
NVNT	ac40	5270	Ant2	36.024
NVNT	ac40	5310	Ant2	36.139
NVNT	ac40	5510	Ant2	36.154
NVNT	ac40	5550	Ant2	36.044
NVNT	ac40	5670	Ant2	36.191
NVNT	ac40	5755	Ant2	36.13
NVNT	ac40	5795	Ant2	36.038
NVNT	ac80	5210	Ant1	75.897



NVNT	ac80	5290	Ant1	75.921
NVNT	ac80	5530	Ant1	75.897
NVNT	ac80	5610	Ant1	75.675
NVNT	ac80	5775	Ant1	75.705
NVNT	ac80	5210	Ant2	75.6
NVNT	ac80	5290	Ant2	75.684
NVNT	ac80	5530	Ant2	75.591
NVNT	ac80	5610	Ant2	75.517
NVNT	ac80	5775	Ant2	75.517
NVNT	ax20	5180	Ant1	19.156
NVNT	ax20	5200	Ant1	19.154
NVNT	ax20	5240	Ant1	19.032
NVNT	ax20	5260	Ant1	19.071
NVNT	ax20	5300	Ant1	19.163
NVNT	ax20	5320	Ant1	19.15
NVNT	ax20	5500	Ant1	19.082
NVNT	ax20	5580	Ant1	19.004
NVNT	ax20	5700	Ant1	19.138
NVNT	ax20	5745	Ant1	19.117
NVNT	ax20	5785	Ant1	18.991
NVNT	ax20	5825	Ant1	19.043
NVNT	ax20	5180	Ant2	19.145
NVNT	ax20	5200	Ant2	19.167
NVNT	ax20	5240	Ant2	19.066
NVNT	ax20	5260	Ant2	18.998
NVNT	ax20	5300	Ant2	19.177
NVNT	ax20	5320	Ant2	19.137
NVNT	ax20	5500	Ant2	19.123
NVNT	ax20	5580	Ant2	19.034
NVNT	ax20	5700	Ant2	19.102
NVNT	ax20	5745	Ant2	19.087
NVNT	ax20	5785	Ant2	18.992
NVNT	ax20	5825	Ant2	19.041
NVNT	ax40	5190	Ant1	37.759
NVNT	ax40	5230	Ant1	37.584
NVNT	ax40	5270	Ant1	37.624
NVNT	ax40	5310	Ant1	37.744
NVNT	ax40	5510	Ant1	37.731
NVNT	ax40	5550	Ant1	37.576
NVNT	ax40	5670	Ant1	37.748
NVNT	ax40	5755	Ant1	37.706
NVNT	ax40	5795	Ant1	37.534
NVNT	ax40	5190	Ant2	37.518
NVNT	ax40	5230	Ant2	37.527
NVNT	ax40	5270	Ant2	35.432
NVNT	ax40	5310	Ant2	37.643
NVNT	ax40	5510	Ant2	37.661
NVNT	ax40	5550	Ant2	37.503
NVNT	ax40	5670	Ant2	37.641
NVNT	ax40	5755	Ant2	37.607
NVNT	ax40	5795	Ant2	37.618
NVNT	ax80	5210	Ant1	77.436
NVNT	ax80	5290	Ant1	77.443
NVNT	ax80	5530	Ant1	77.442
NVNT	ax80	5610	Ant1	77.261
NVNT	ax80	5775	Ant1	77.442



NVNT	ax80	5210	Ant2	77.223
NVNT	ax80	5290	Ant2	77.22
NVNT	ax80	5530	Ant2	77.203
NVNT	ax80	5610	Ant2	77.215
NVNT	ax80	5775	Ant2	77.174





OBW NVNT a 5260MHz Ant1



OBW NVNT a 5300MHz Ant1



OBW NVNT a 5320MHz Ant1





OBW NVNT a 5500MHz Ant1



OBW NVNT a 5580MHz Ant1



OBW NVNT a 5700MHz Ant1





OBW NVNT a 5745MHz Ant1



OBW NVNT a 5785MHz Ant1



OBW NVNT a 5825MHz Ant1





OBW NVNT a 5180MHz Ant2



OBW NVNT a 5200MHz Ant2



OBW NVNT a 5240MHz Ant2





OBW NVNT a 5260MHz Ant2



OBW NVNT a 5300MHz Ant2



OBW NVNT a 5320MHz Ant2





OBW NVNT a 5500MHz Ant2



OBW NVNT a 5580MHz Ant2



OBW NVNT a 5700MHz Ant2





OBW NVNT a 5745MHz Ant2




OBW NVNT a 5785MHz Ant2




OBW NVNT a 5825MHz Ant2






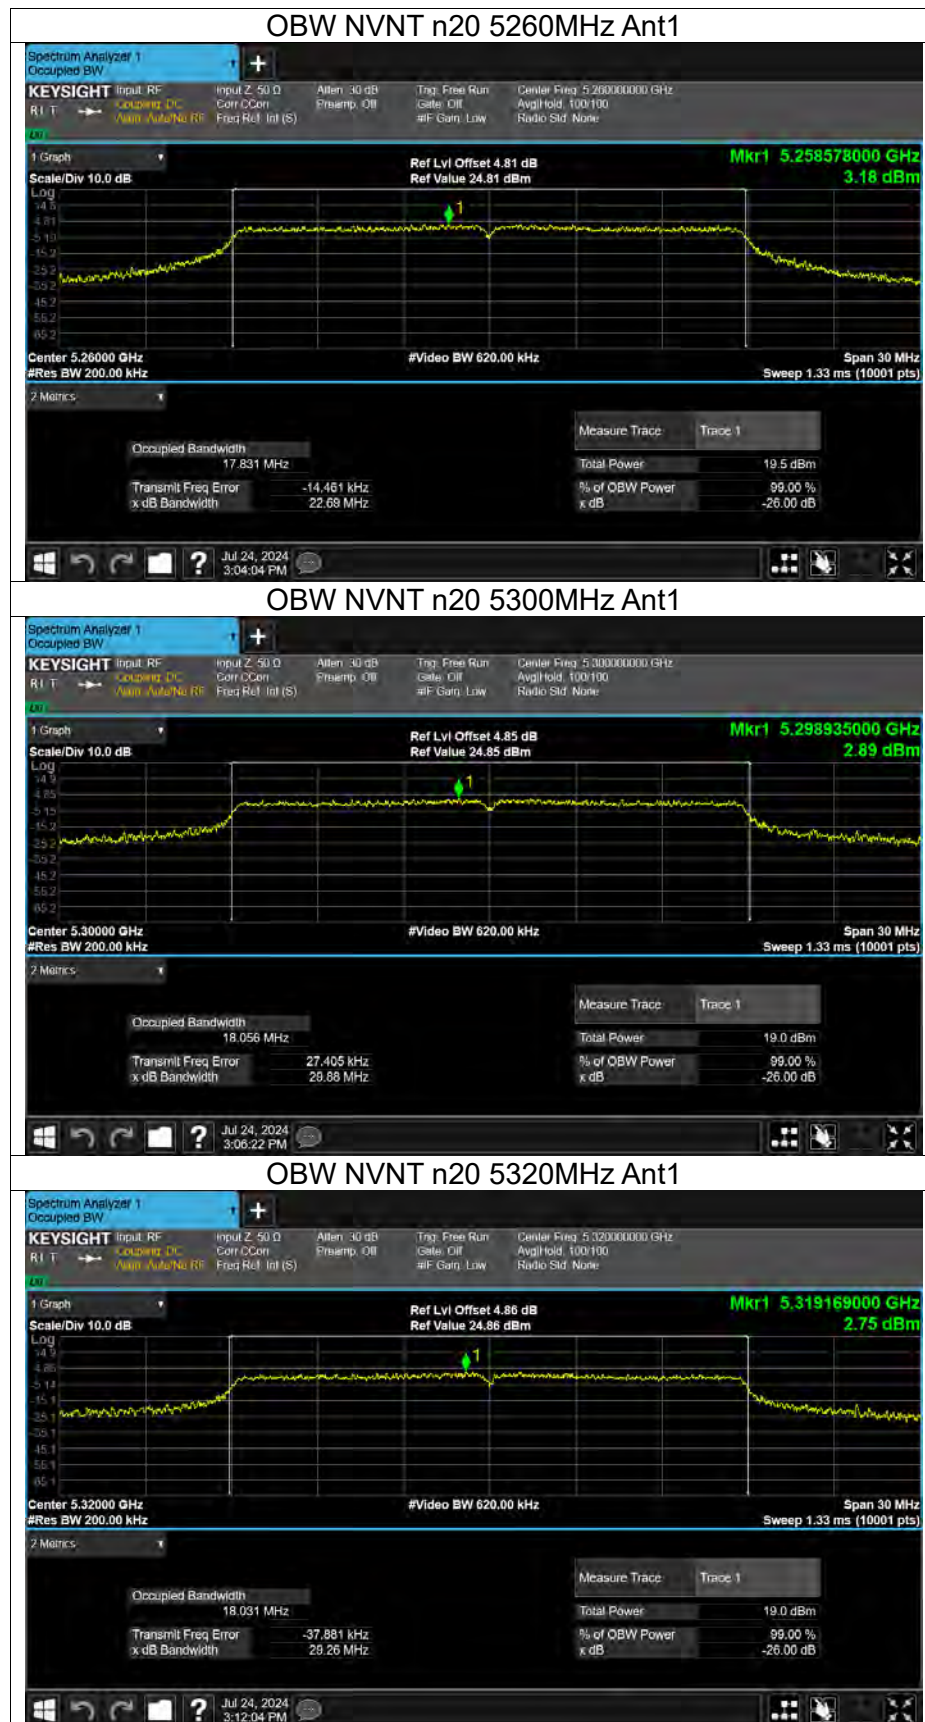



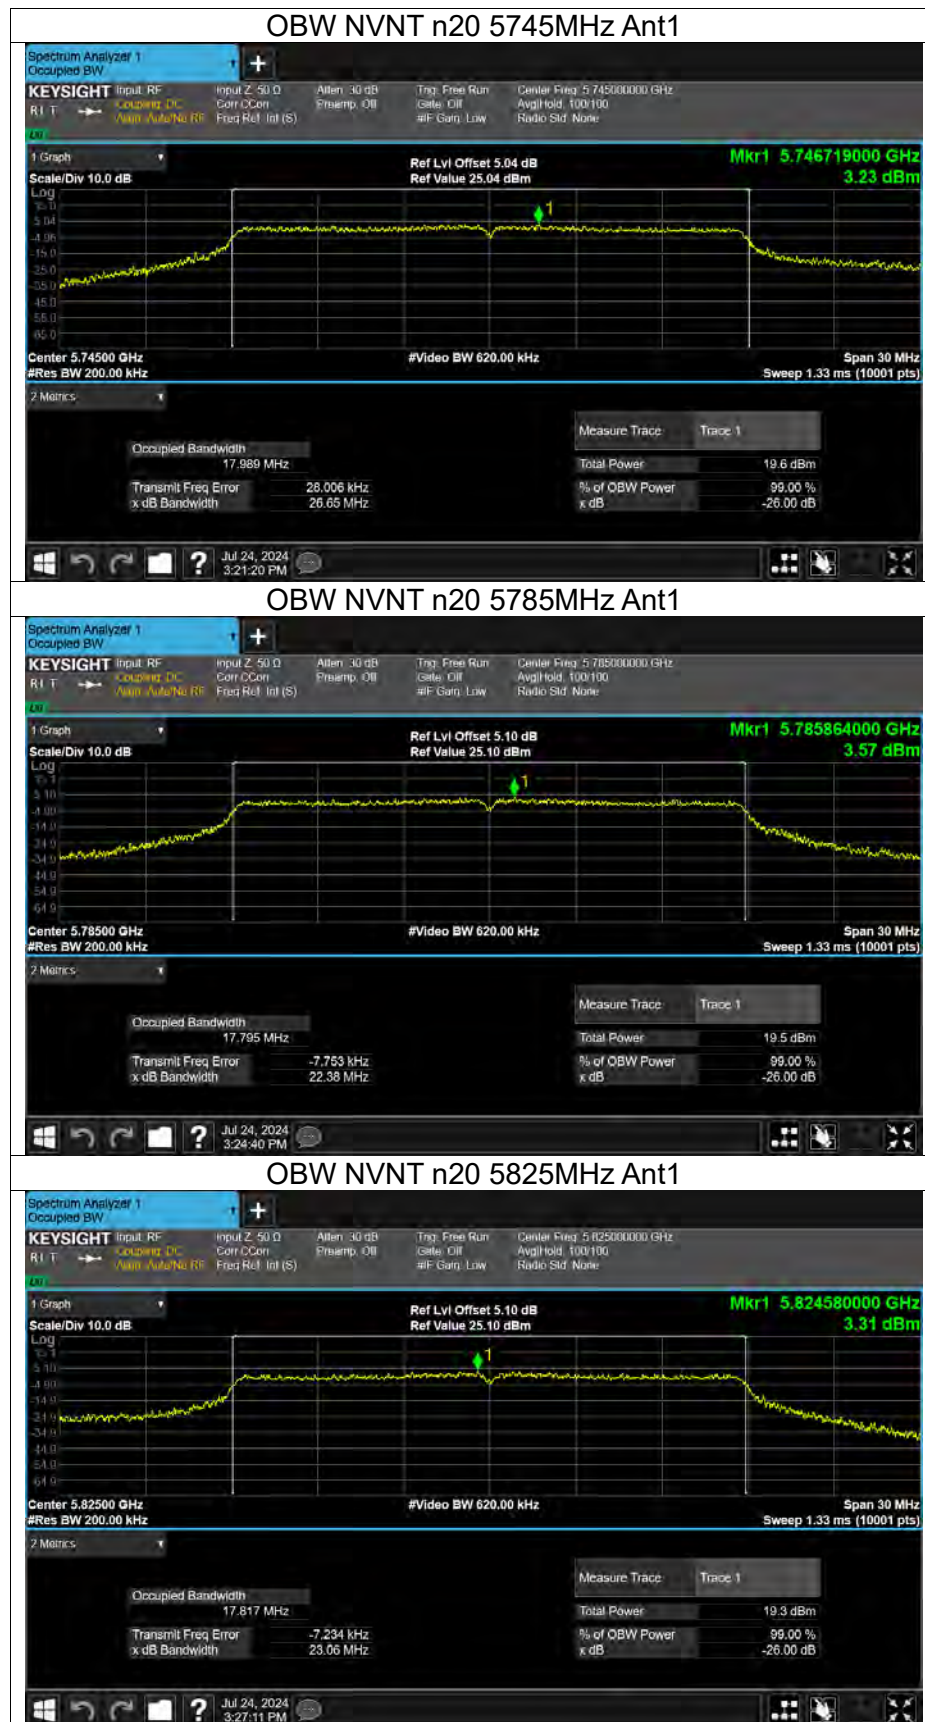


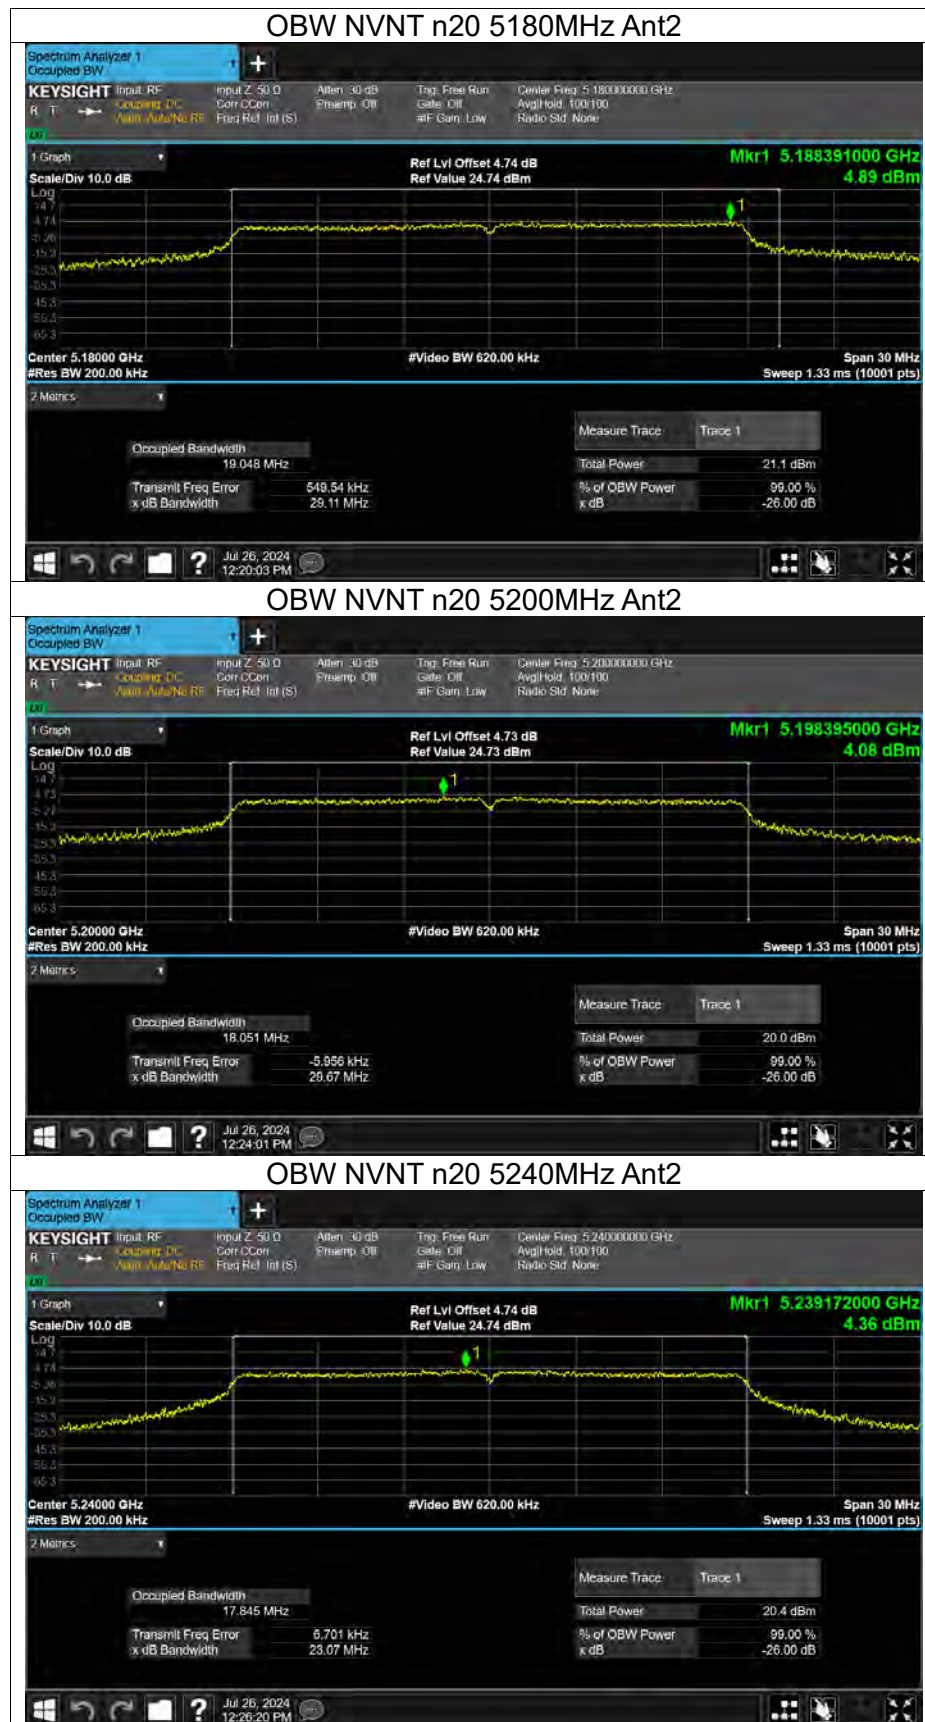









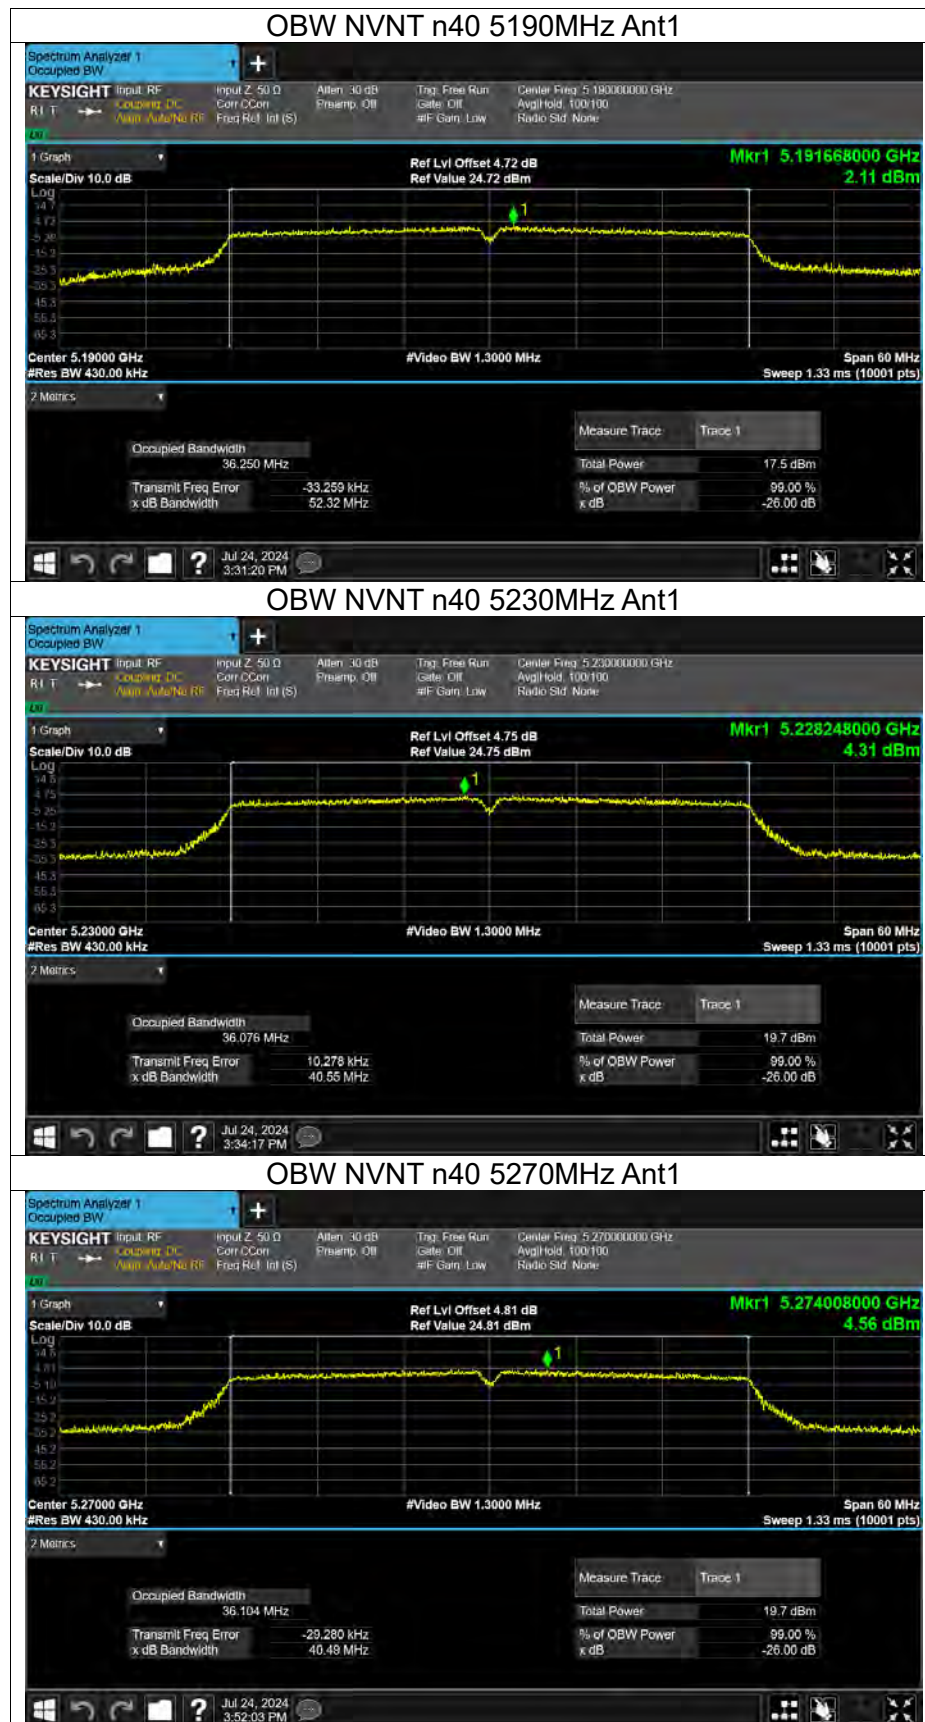




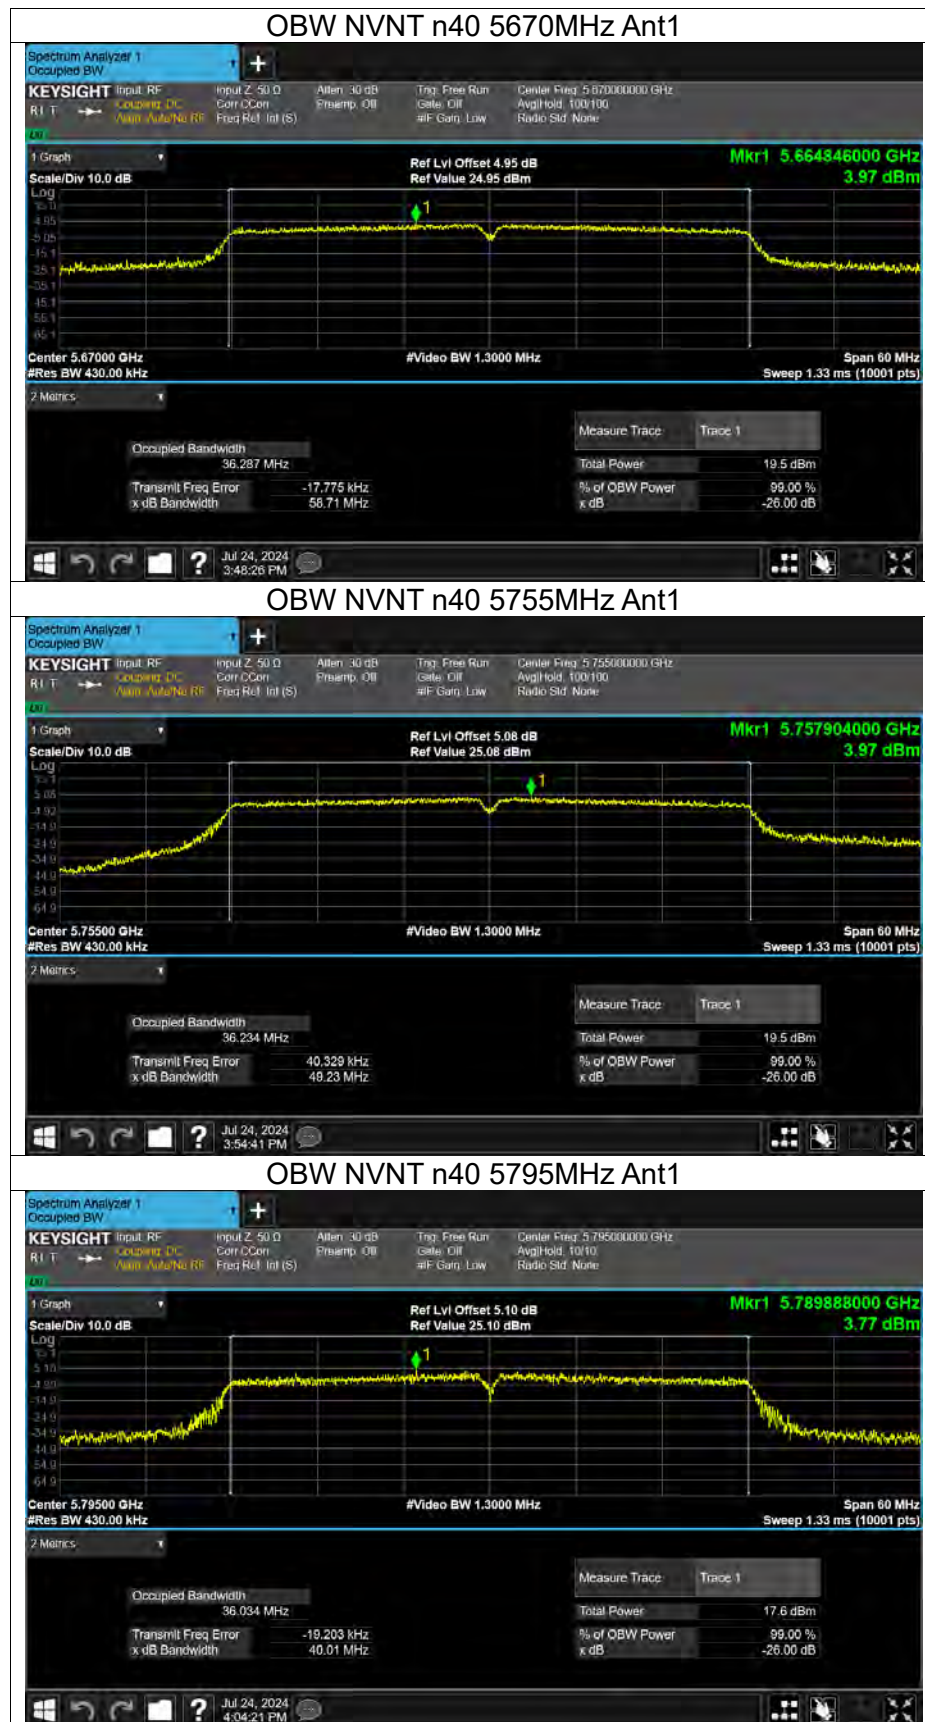

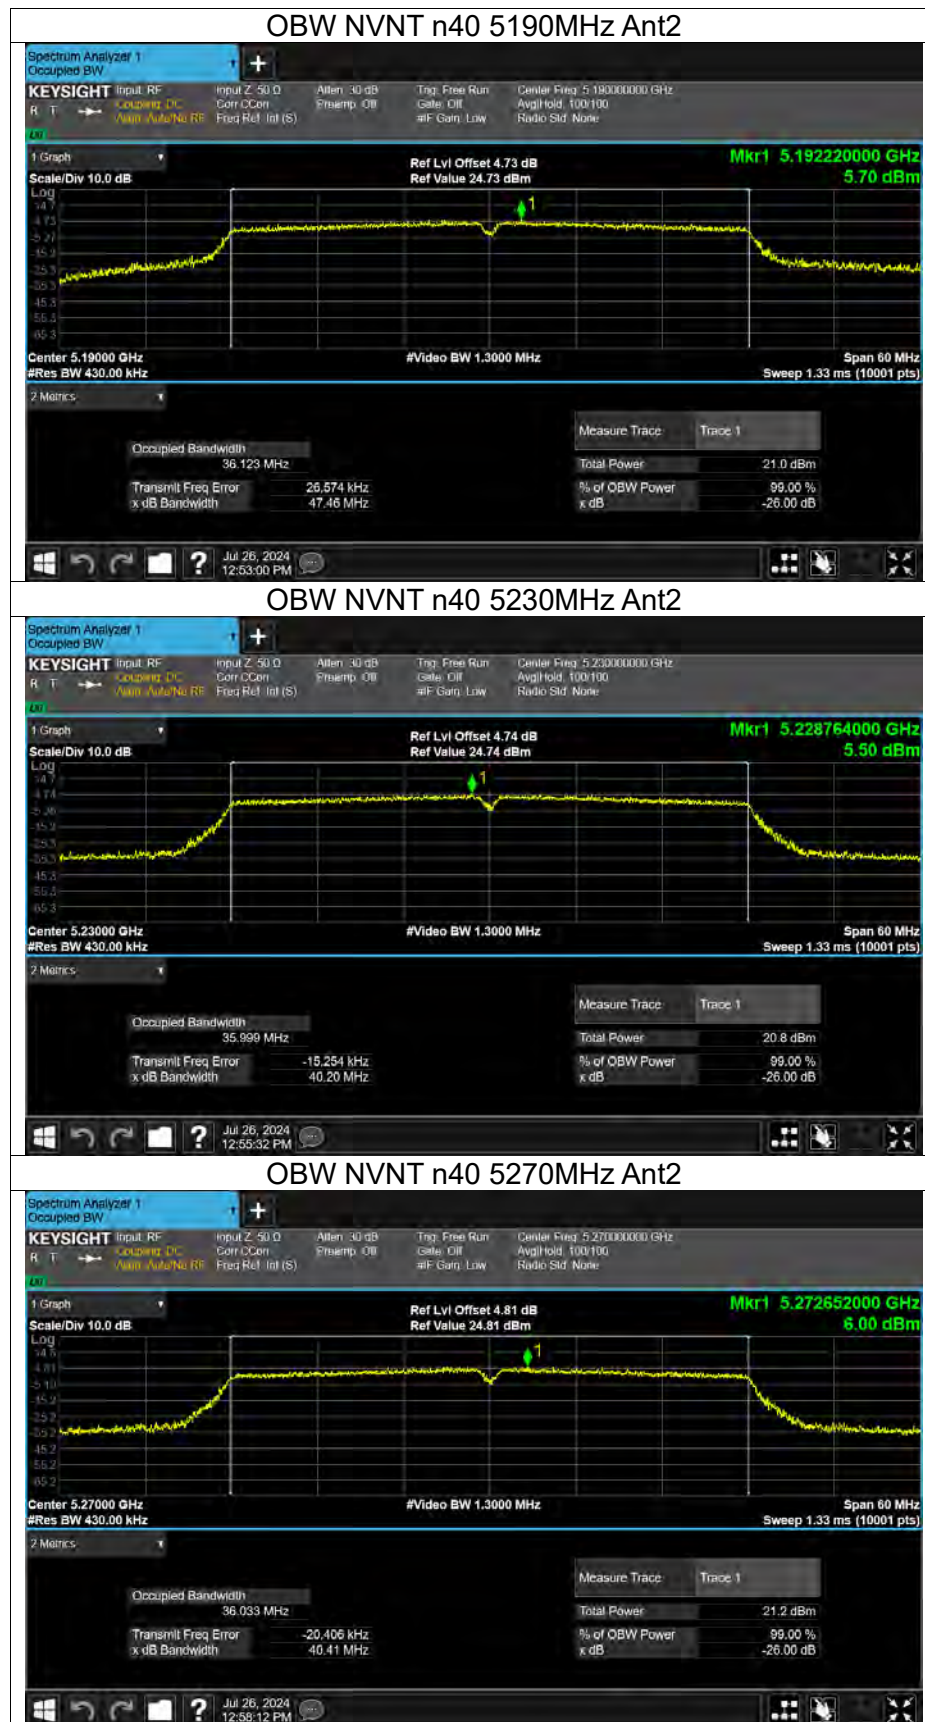



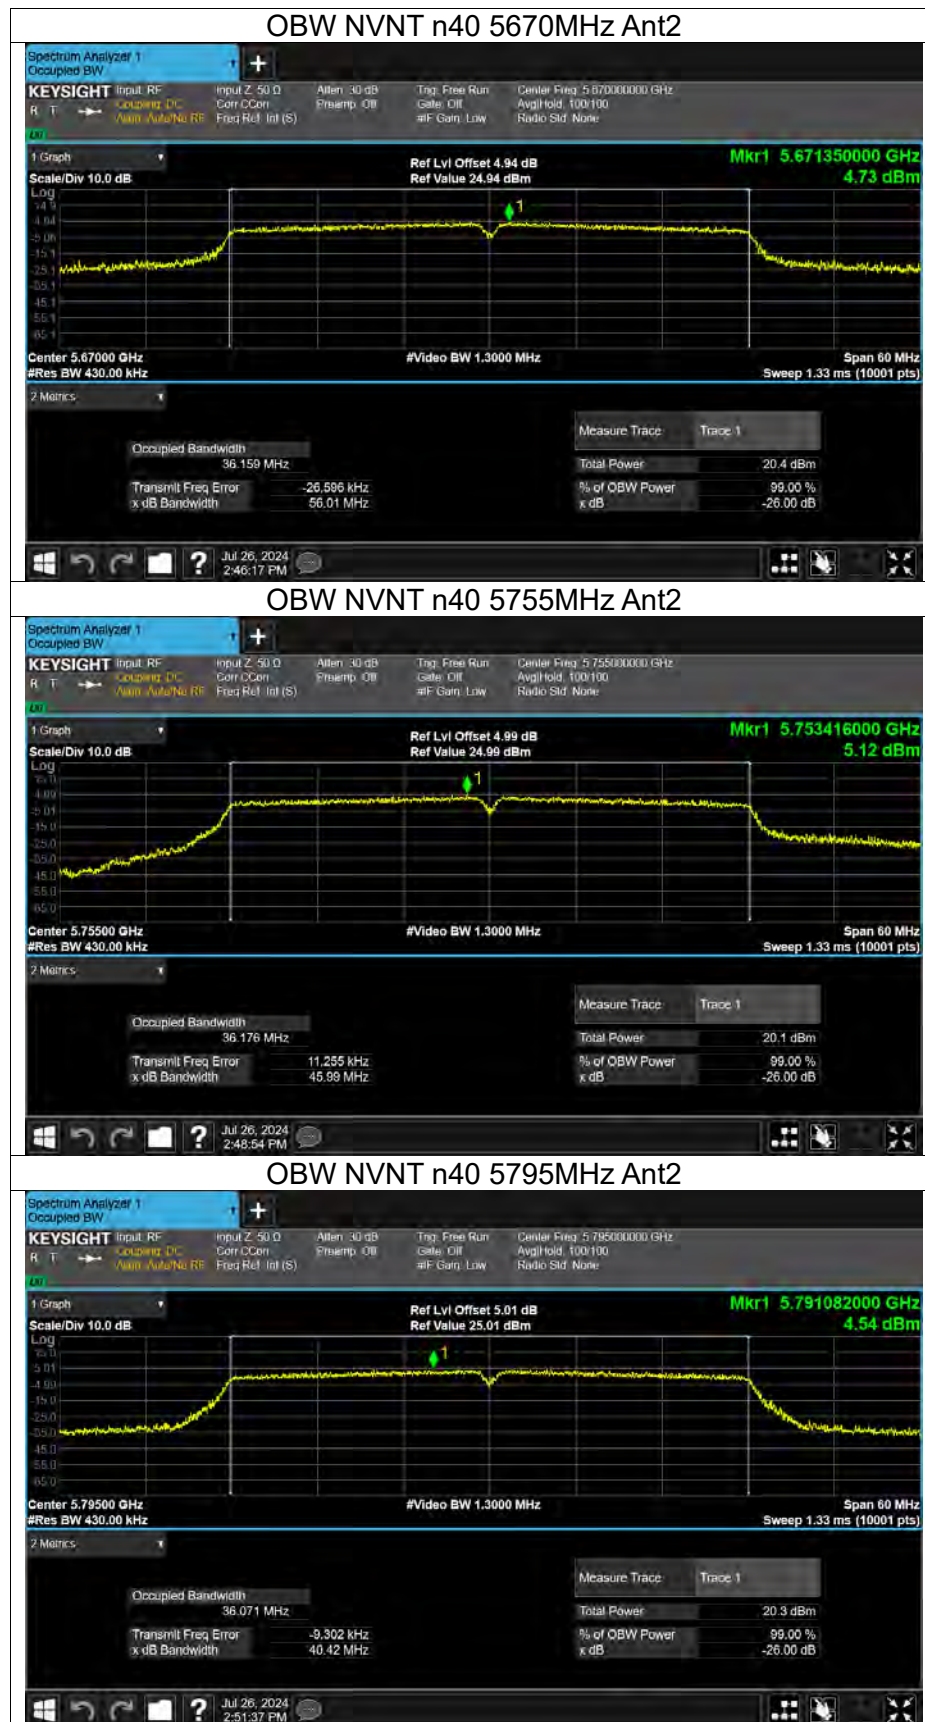










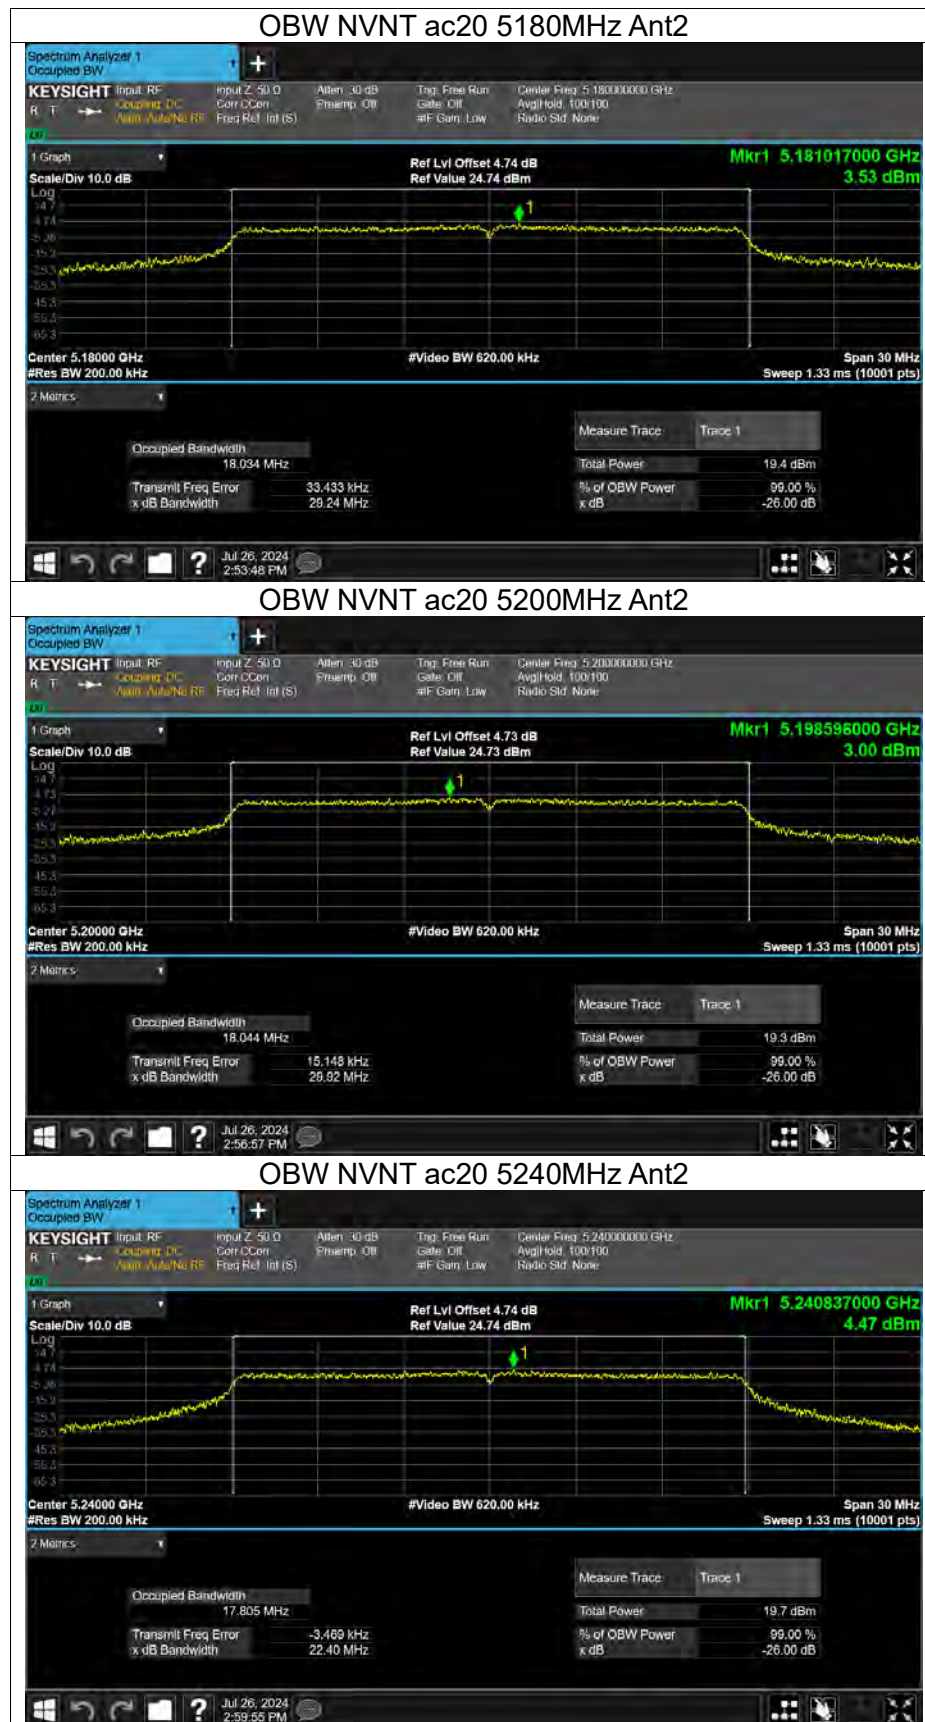



OBW NVNT ac20 5260MHz Ant2



OBW NVNT ac20 5300MHz Ant2



OBW NVNT ac20 5320MHz Ant2





OBW NVNT ac20 5500MHz Ant2







OBW NVNT ac20 5580MHz Ant2






OBW NVNT ac20 5700MHz Ant2





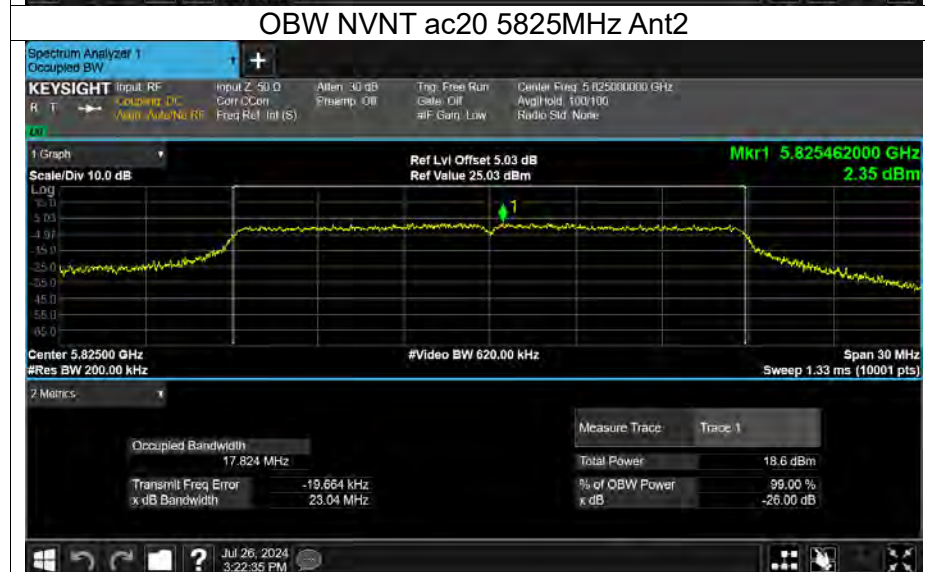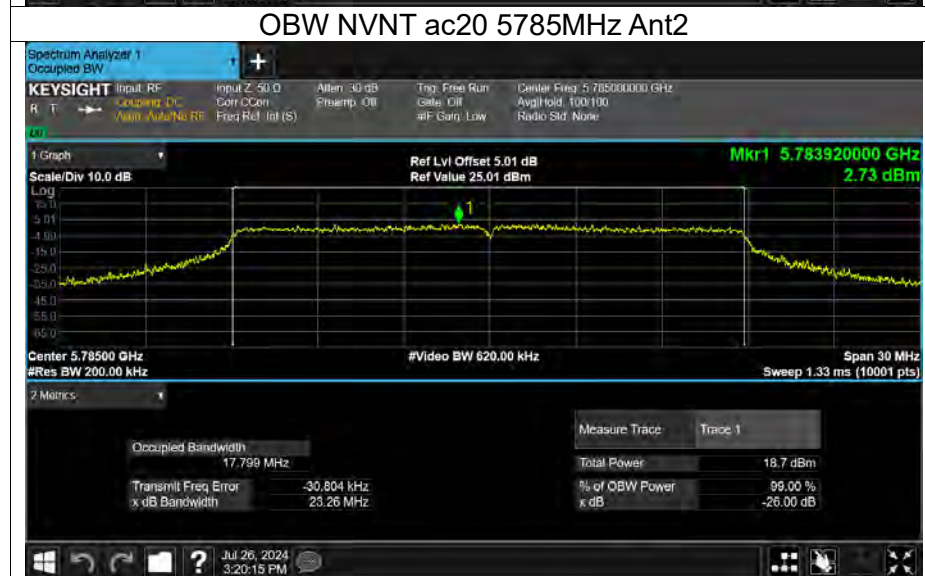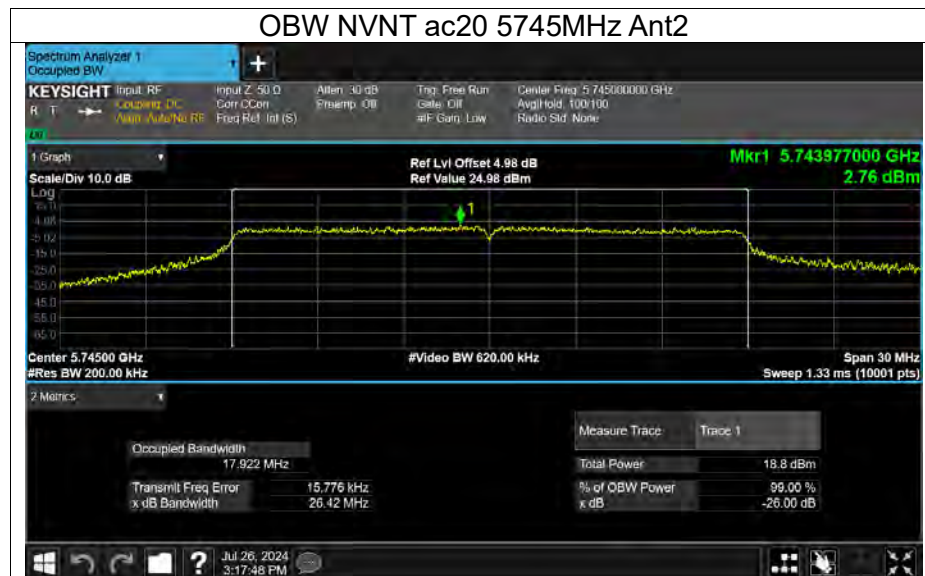

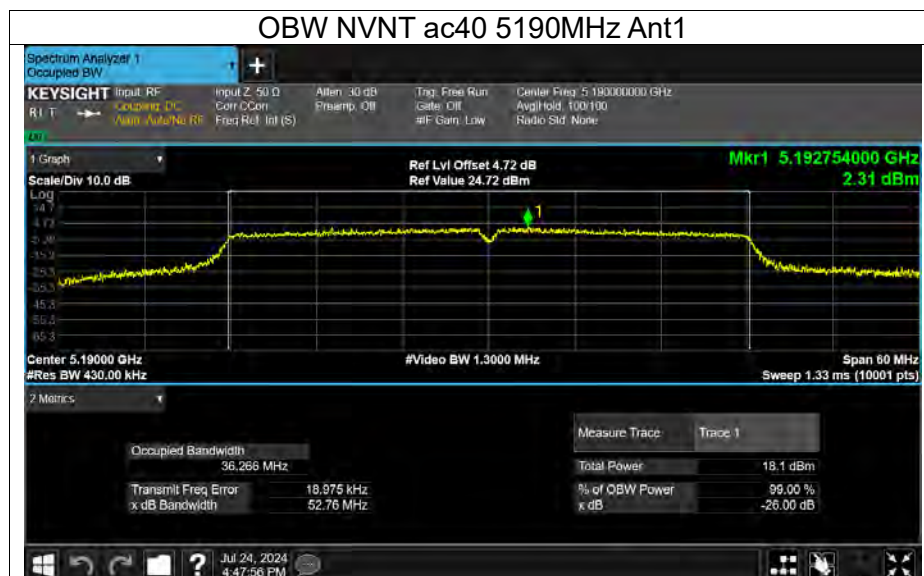

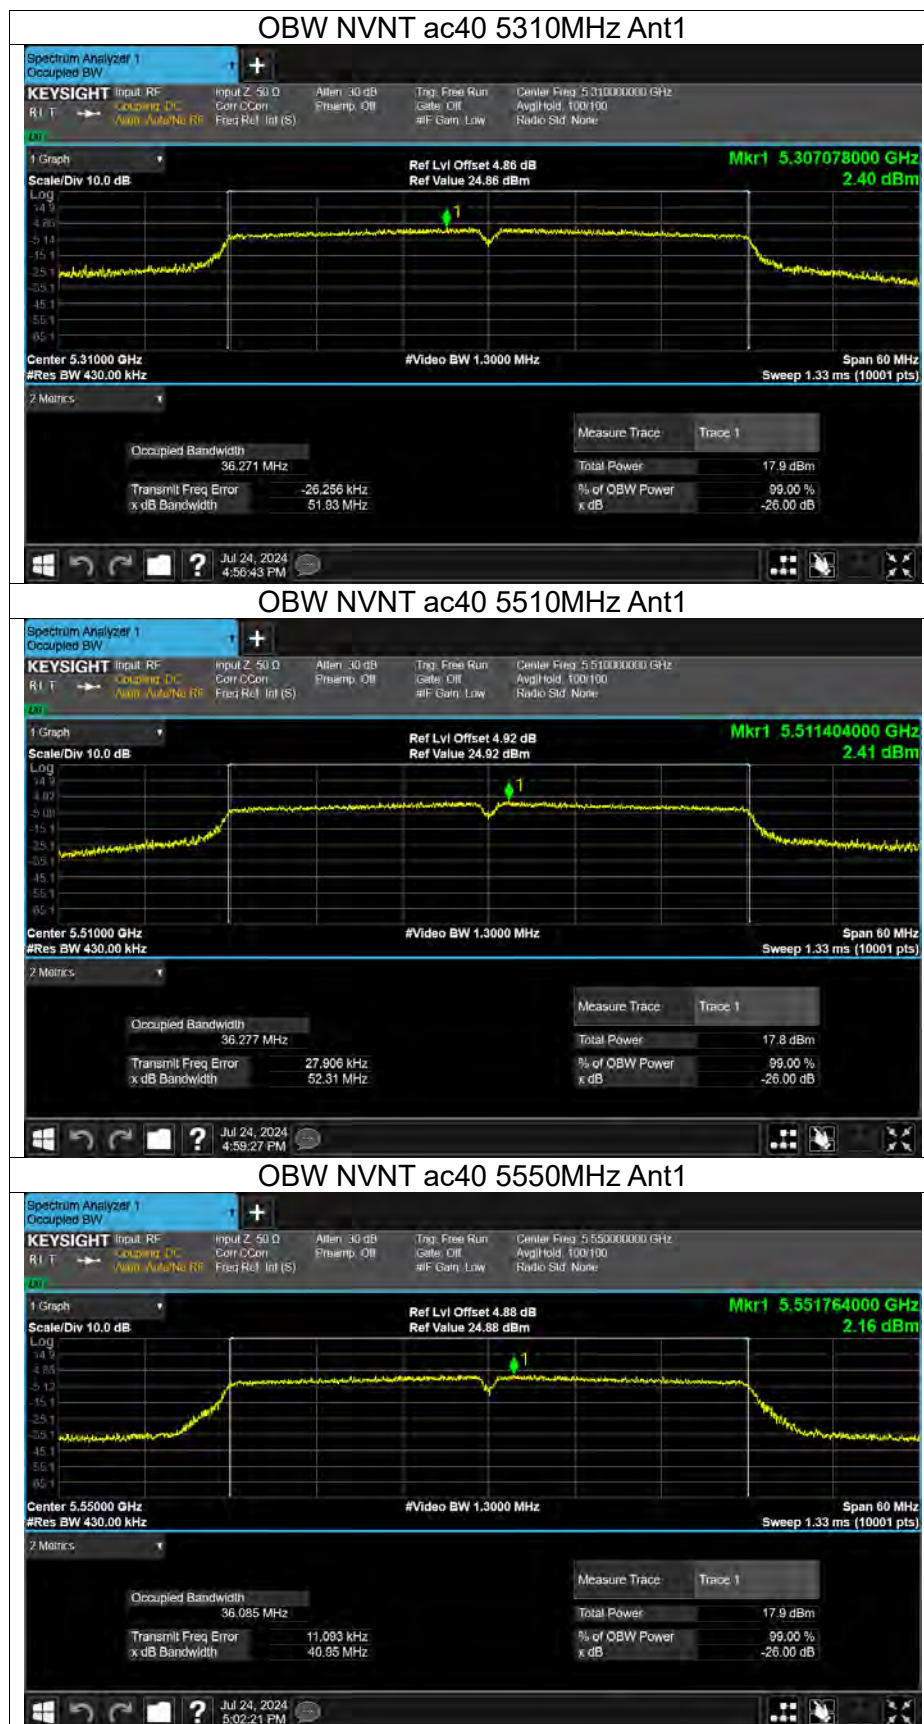

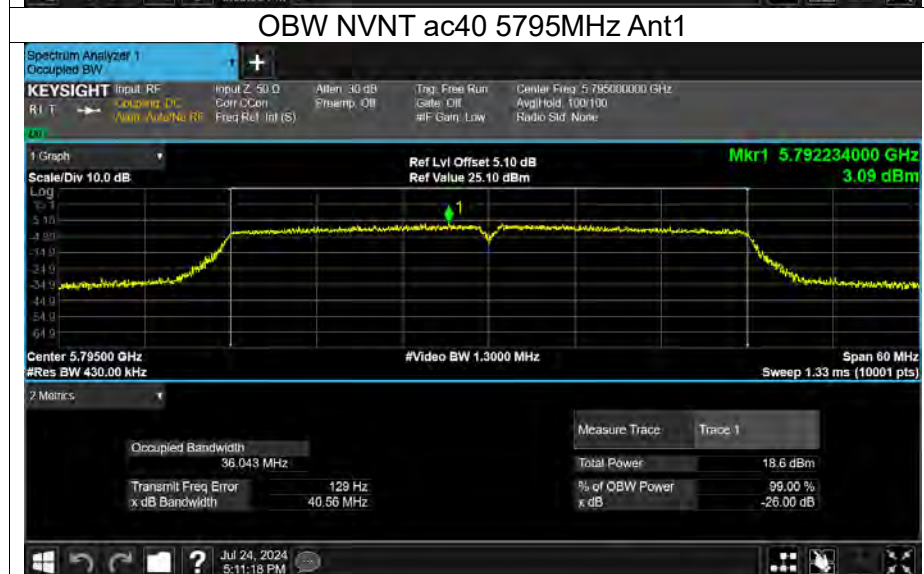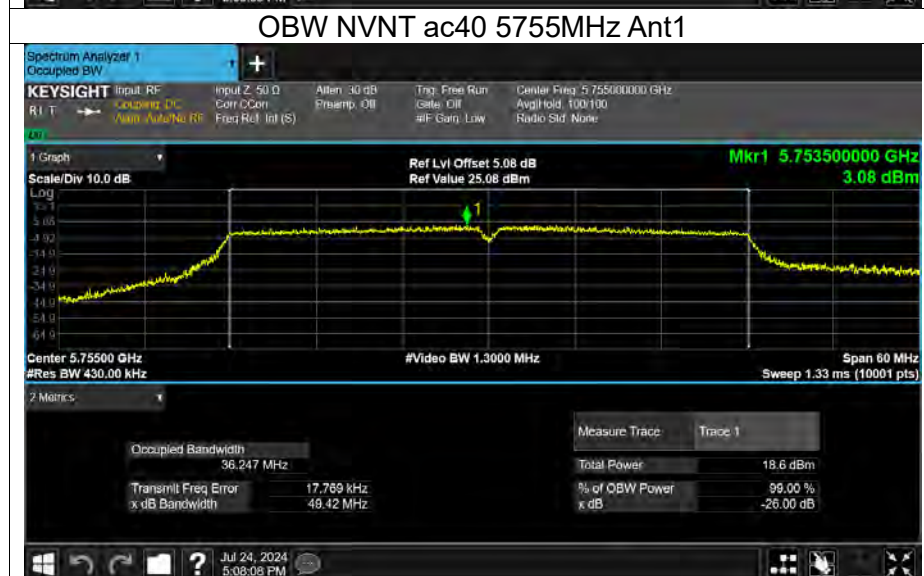


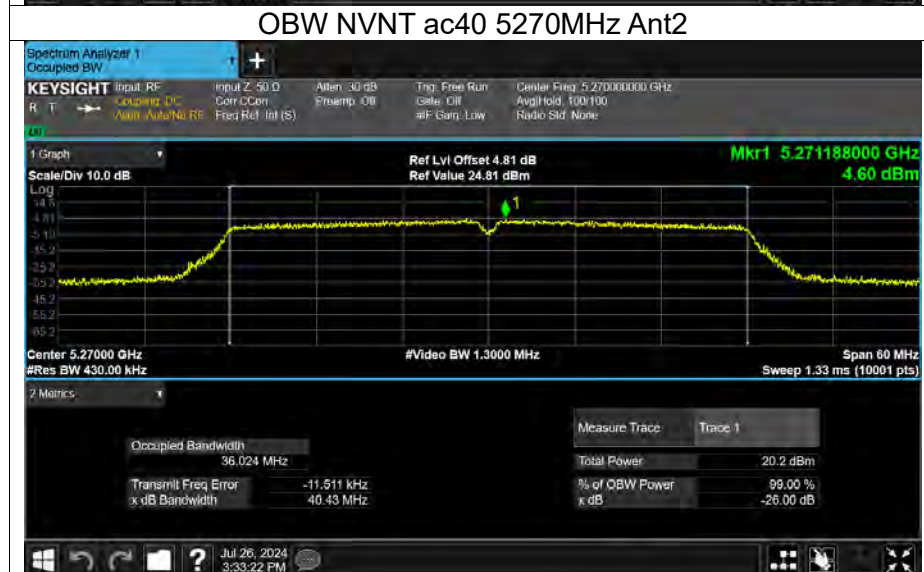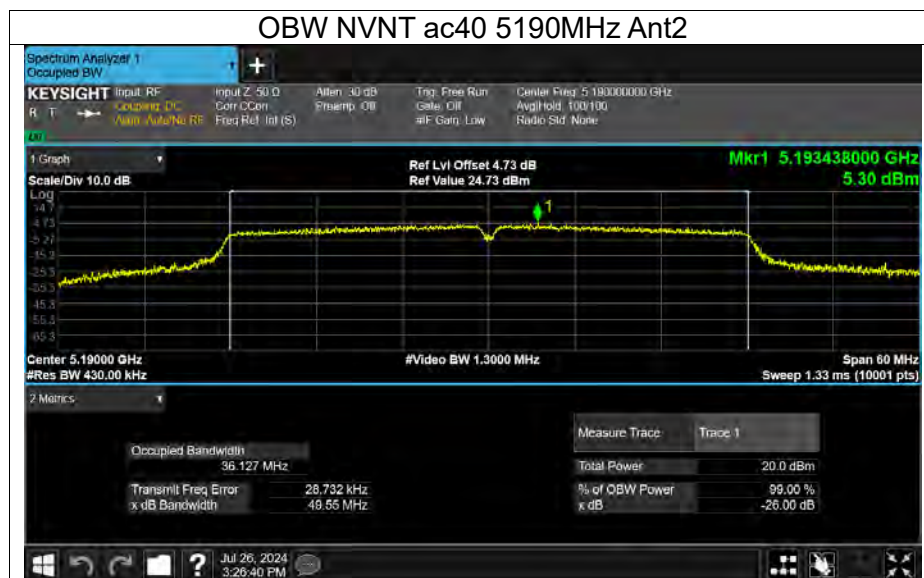














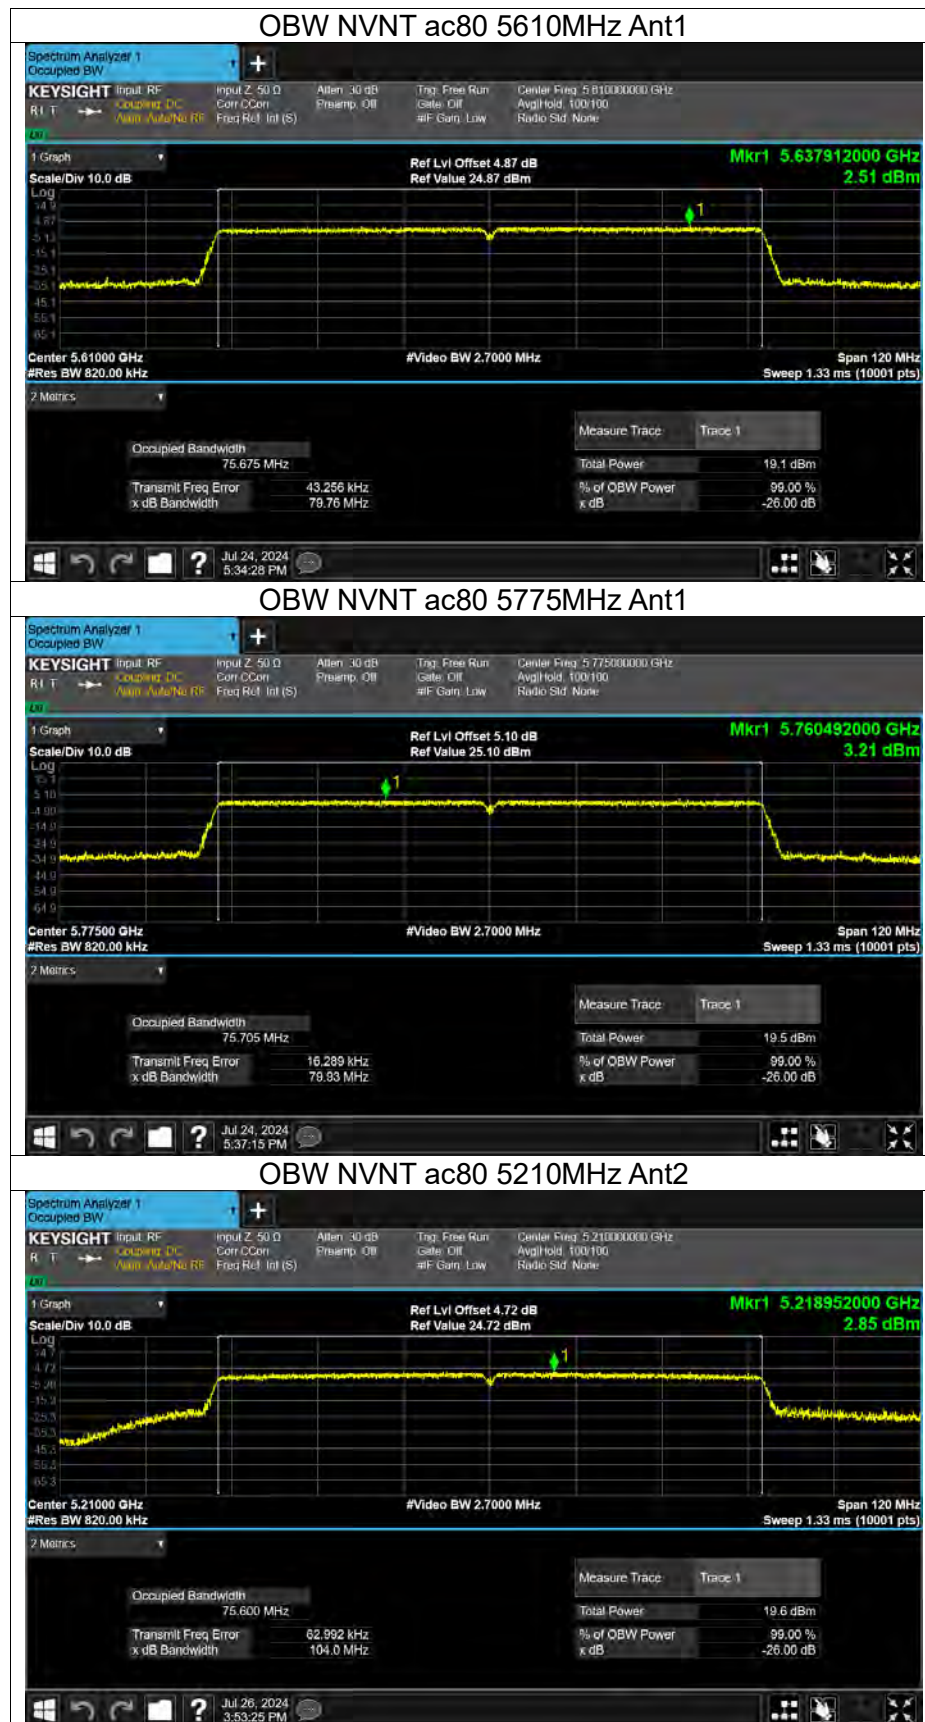

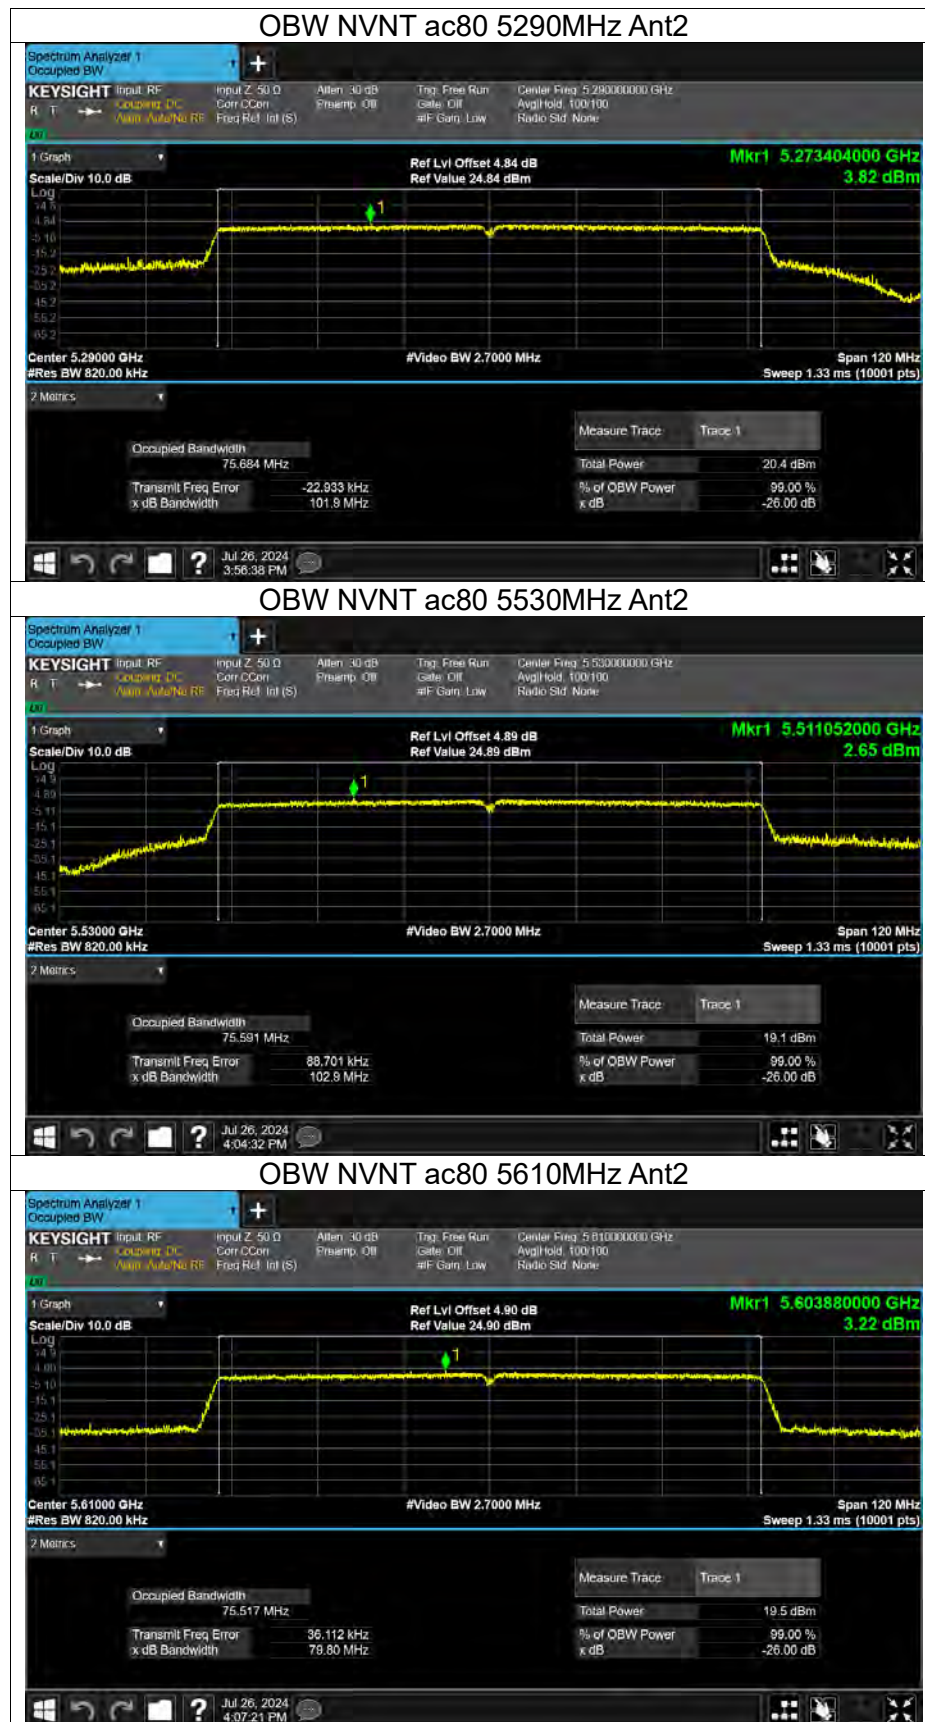

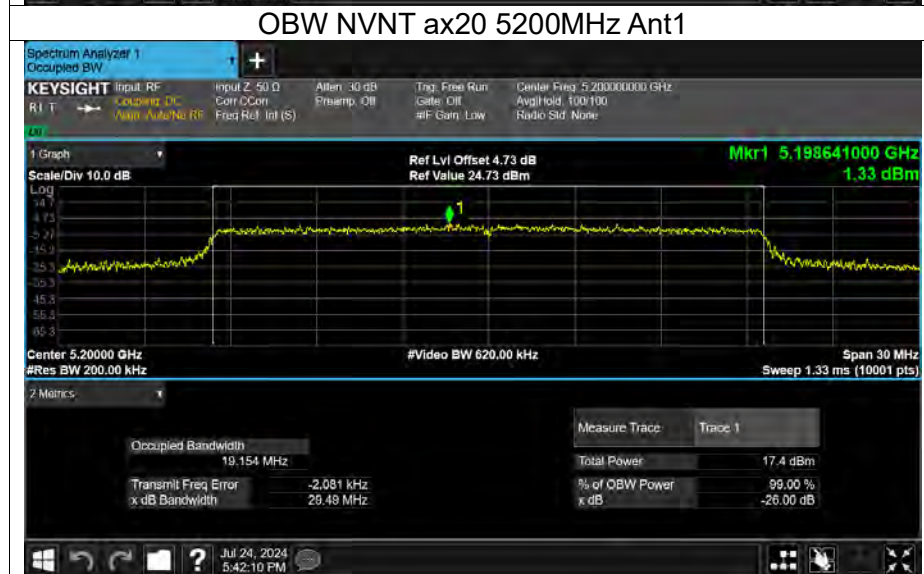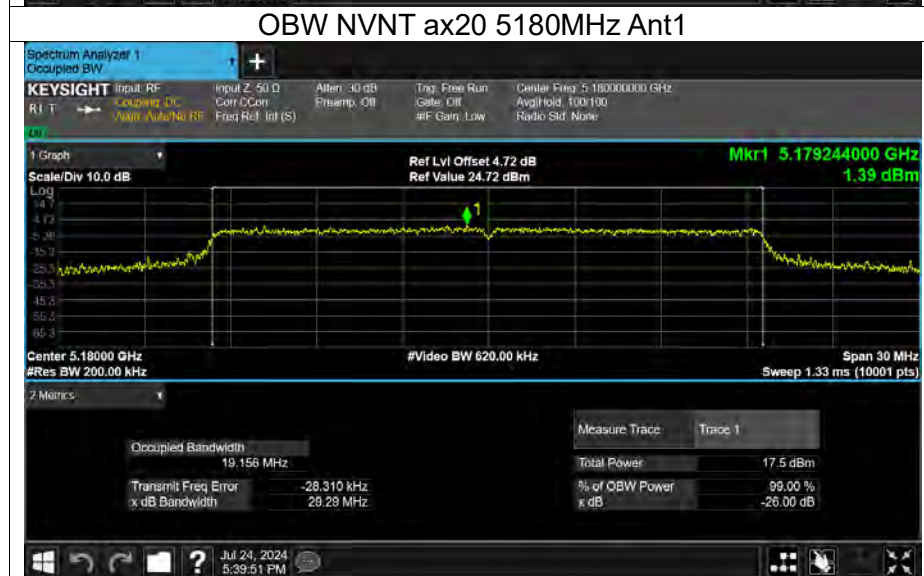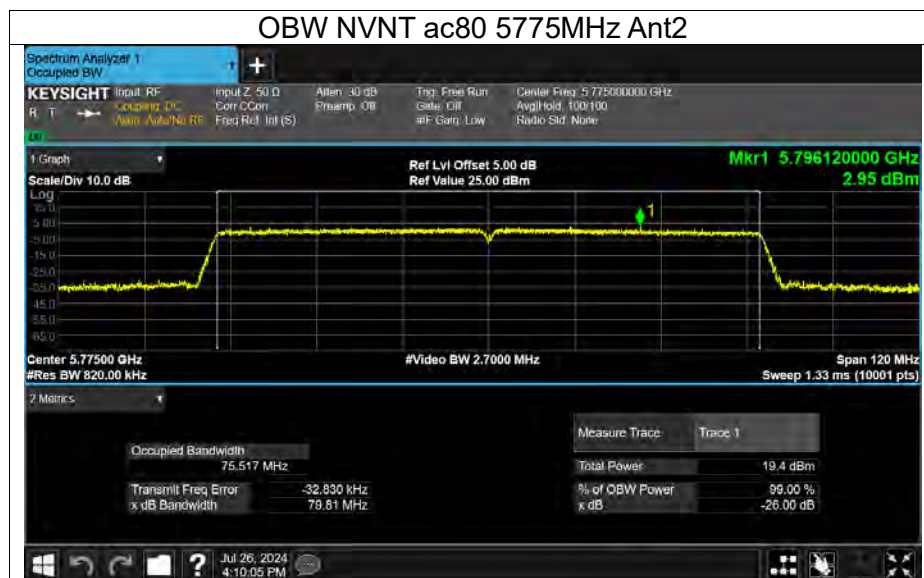



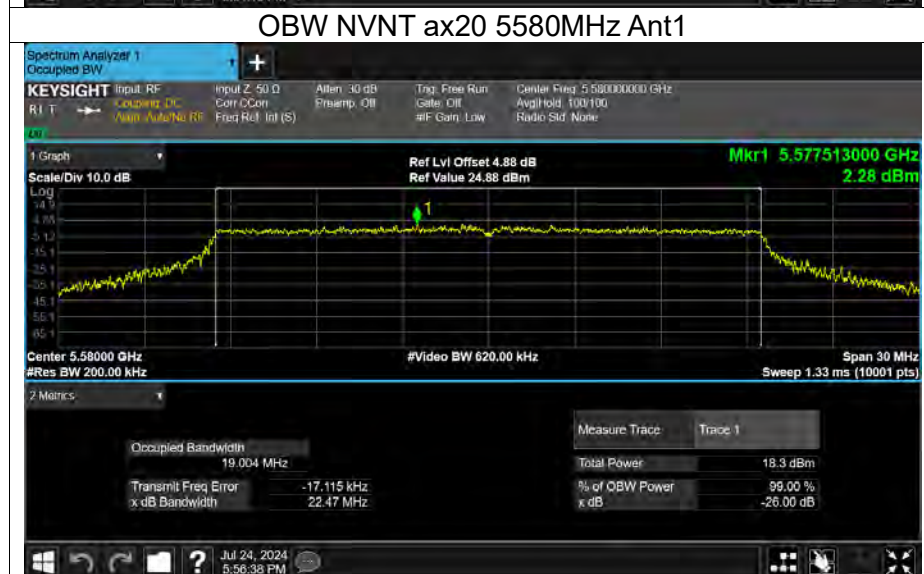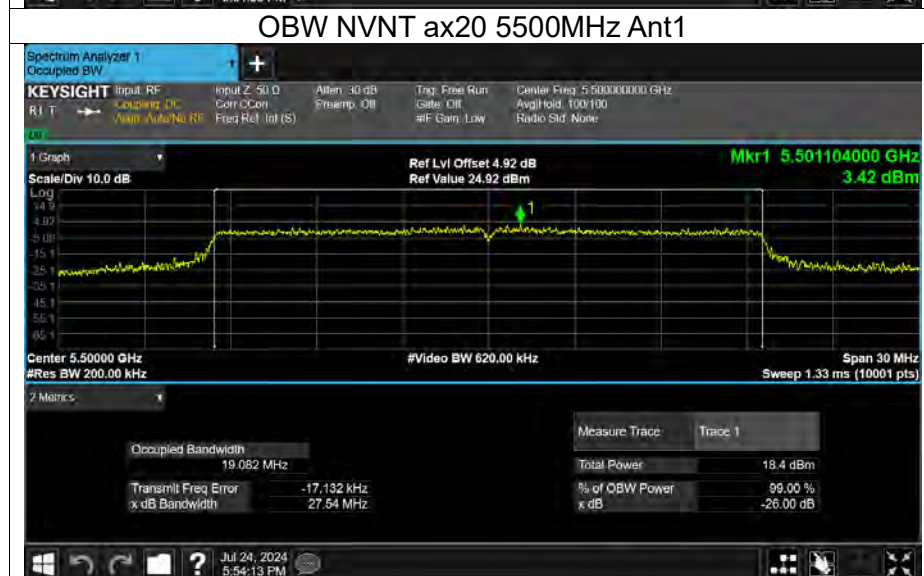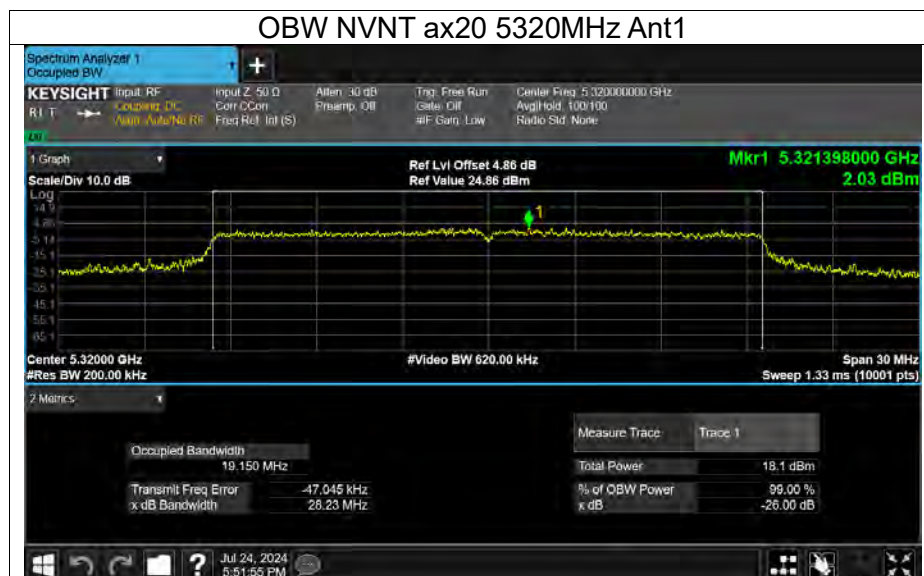



OBW NVNT ax20 5700MHz Ant1




OBW NVNT ax20 5745MHz Ant1



OBW NVNT ax20 5785MHz Ant1



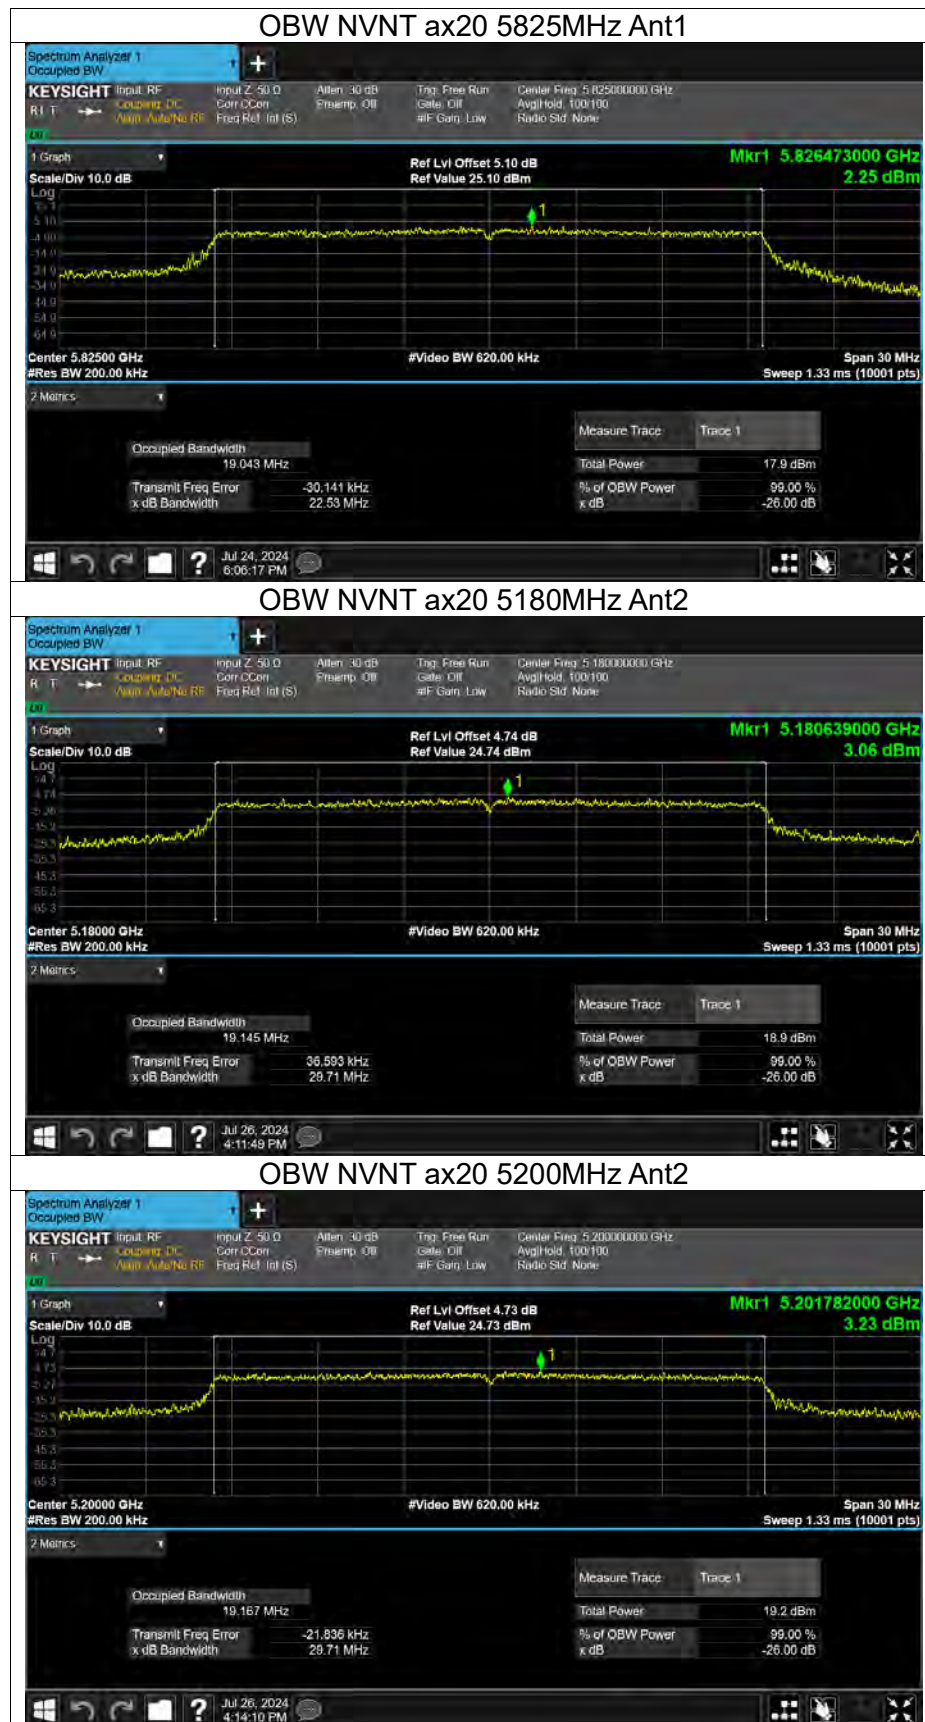



OBW NVNT ax20 5240MHz Ant2



OBW NVNT ax20 5260MHz Ant2



OBW NVNT ax20 5300MHz Ant2









OBW NVNT ax20 5825MHz Ant2







OBW NVNT ax40 5190MHz Ant1






OBW NVNT ax40 5230MHz Ant1



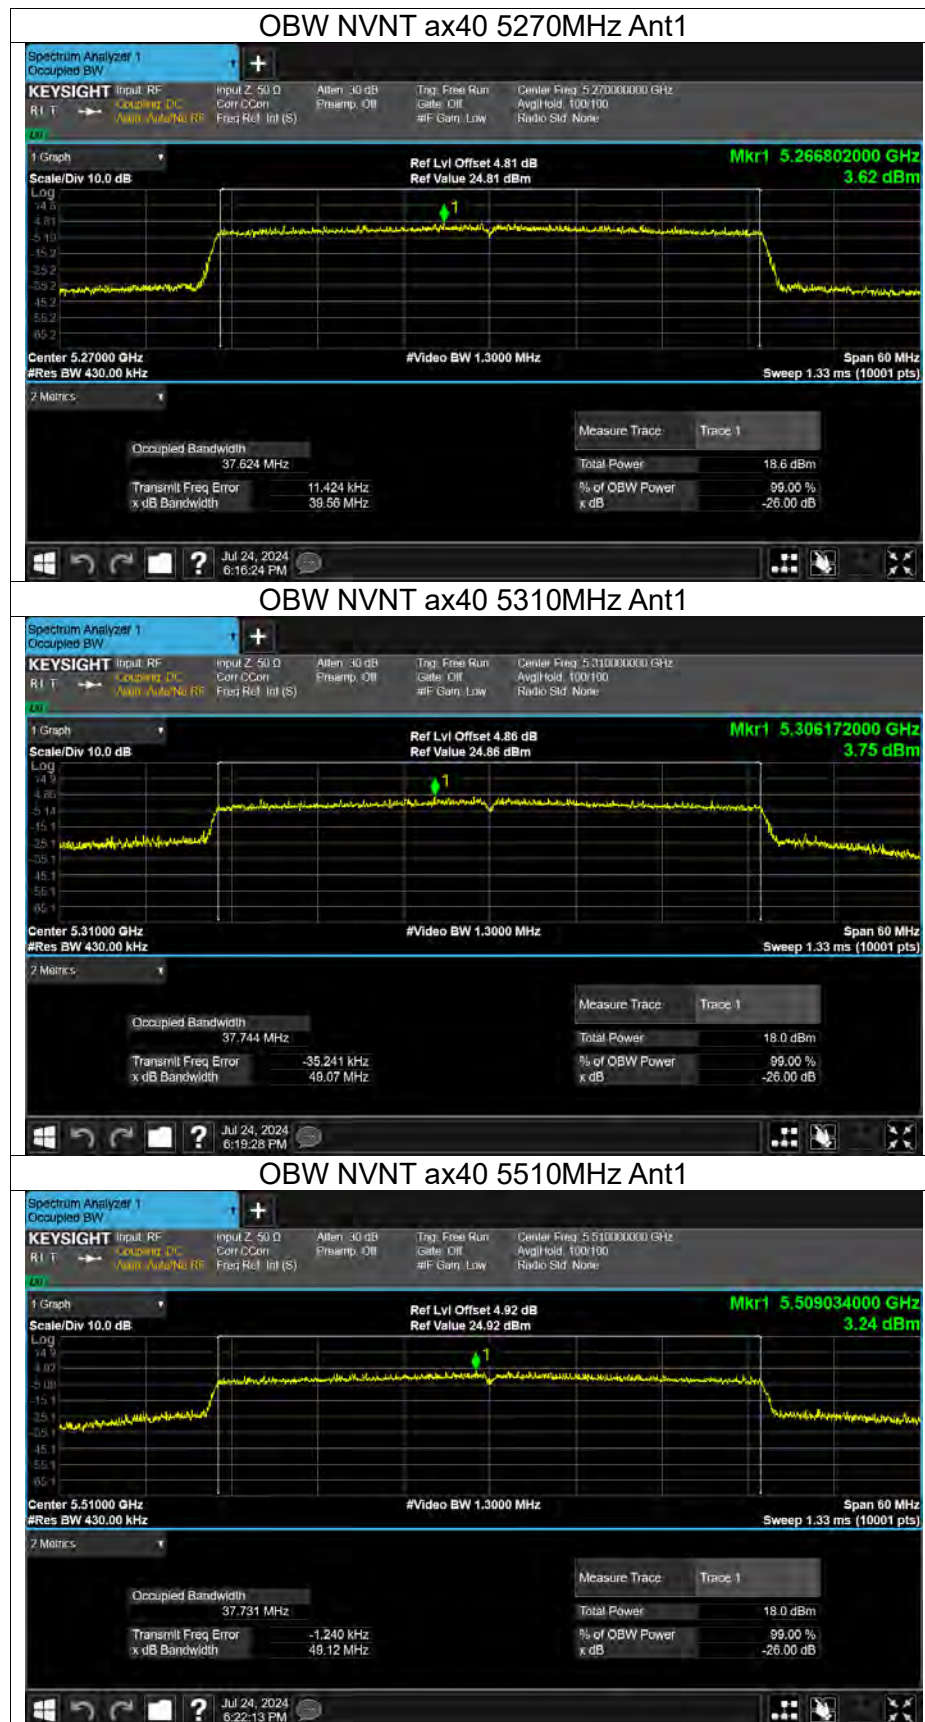

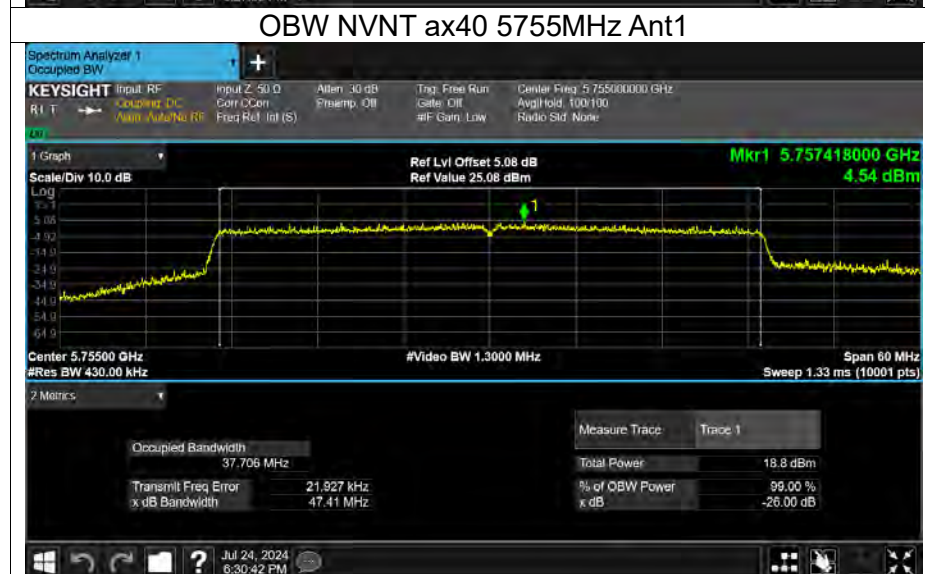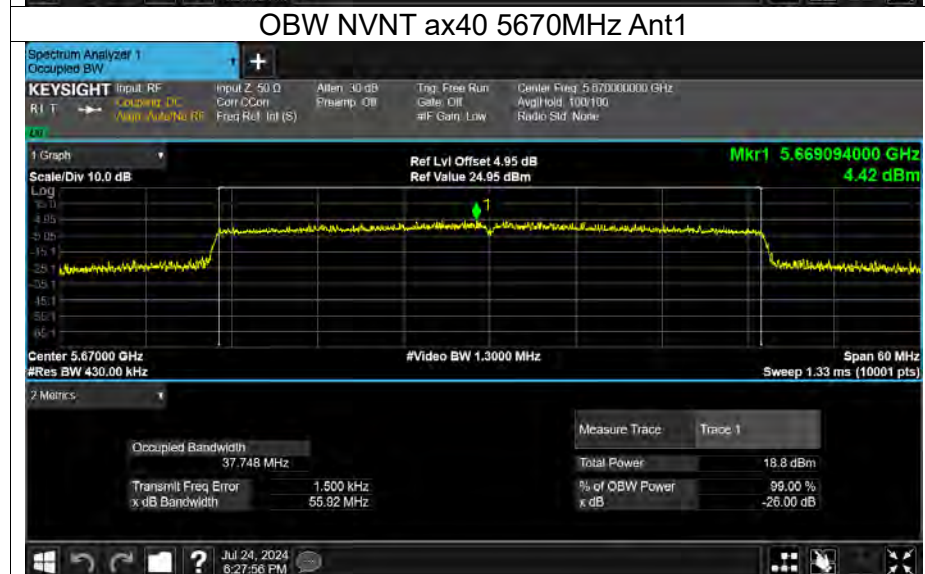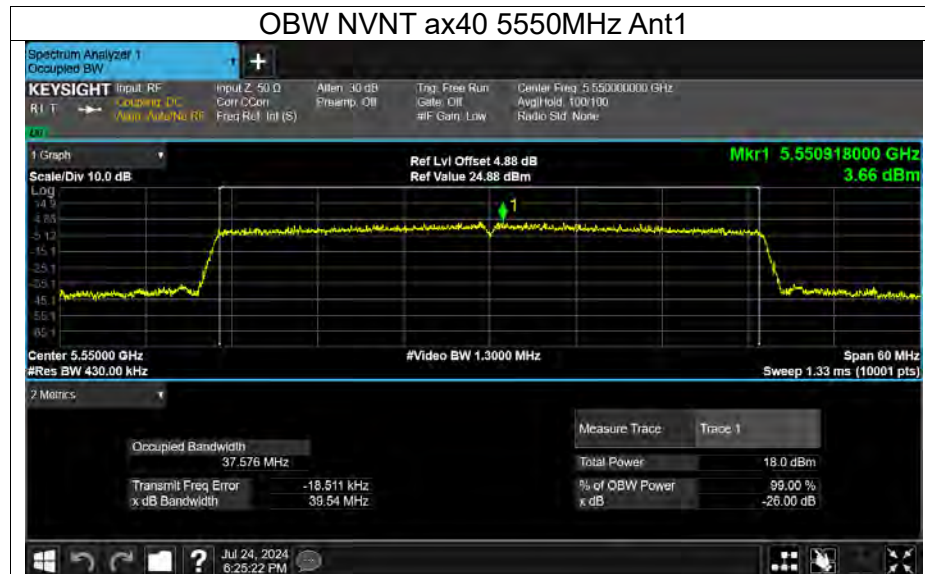

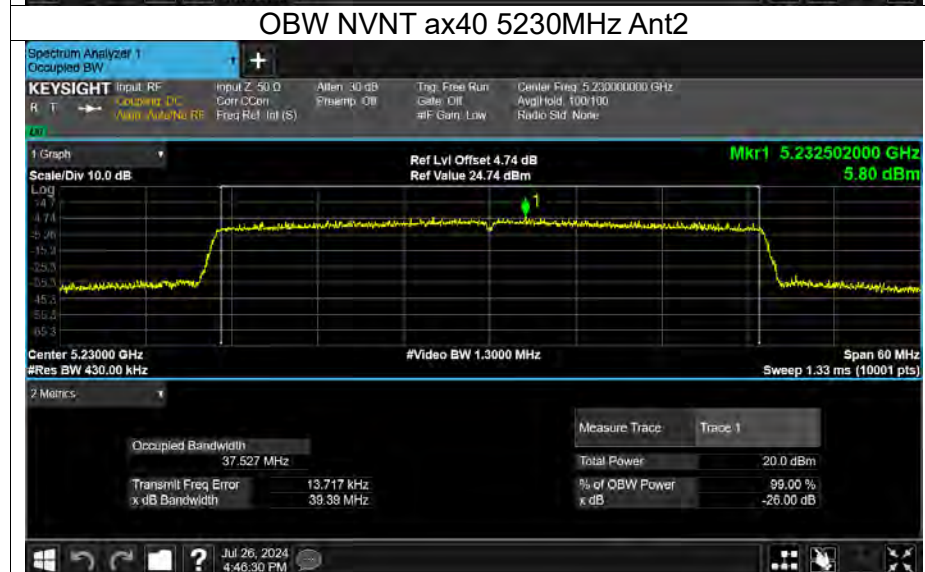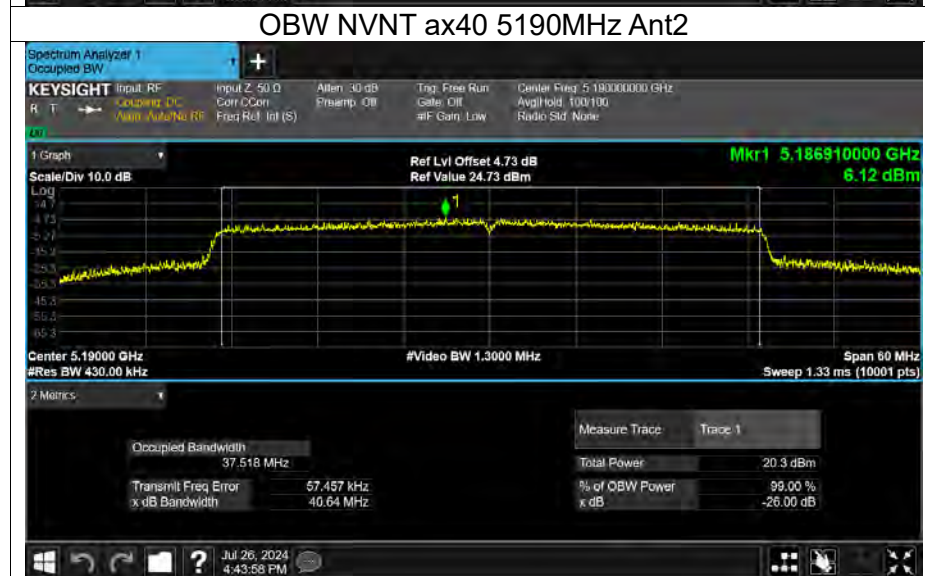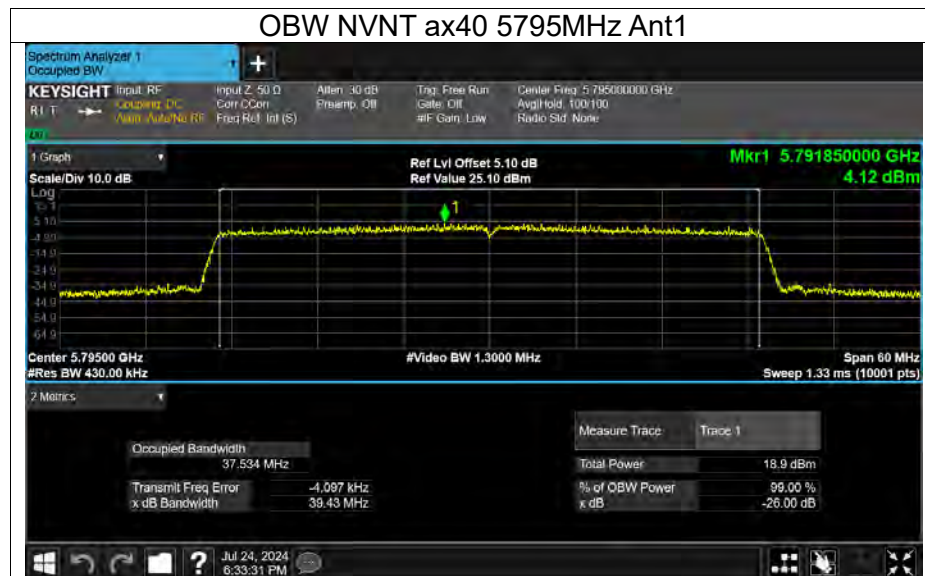





OBW NVNT ax40 5550MHz Ant2




OBW NVNT ax40 5670MHz Ant2



OBW NVNT ax40 5755MHz Ant2



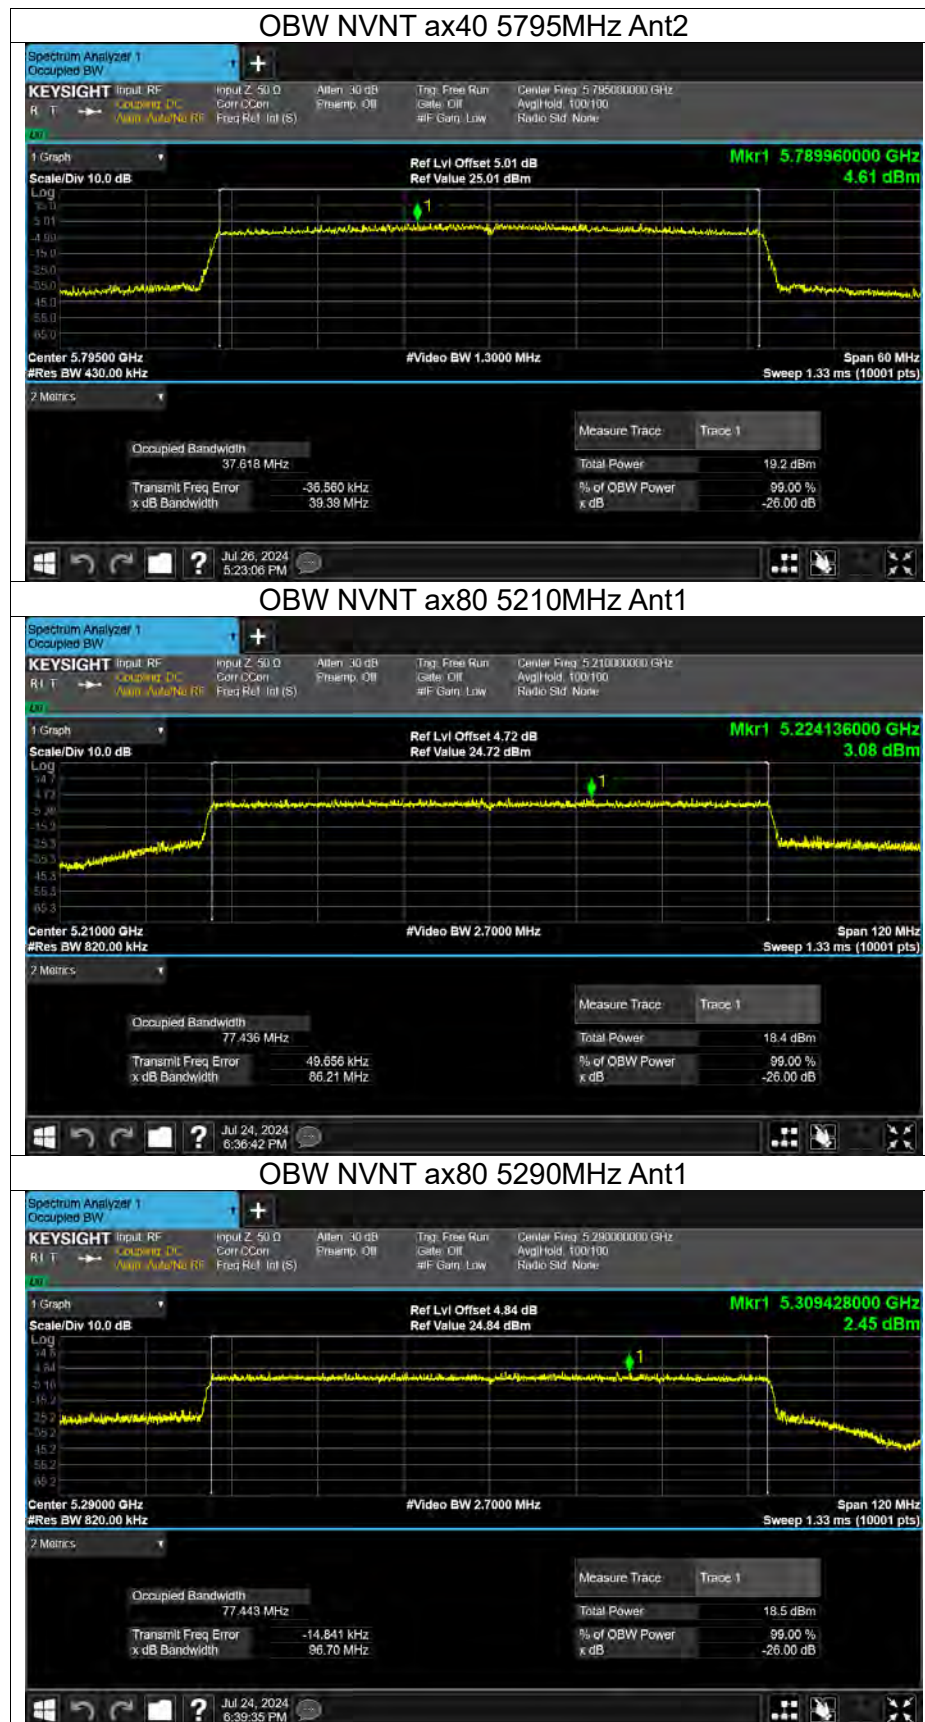



OBW NVNT ax80 5530MHz Ant1



OBW NVNT ax80 5610MHz Ant1



OBW NVNT ax80 5775MHz Ant1





OBW NVNT ax80 5210MHz Ant2




OBW NVNT ax80 5290MHz Ant2



OBW NVNT ax80 5530MHz Ant2



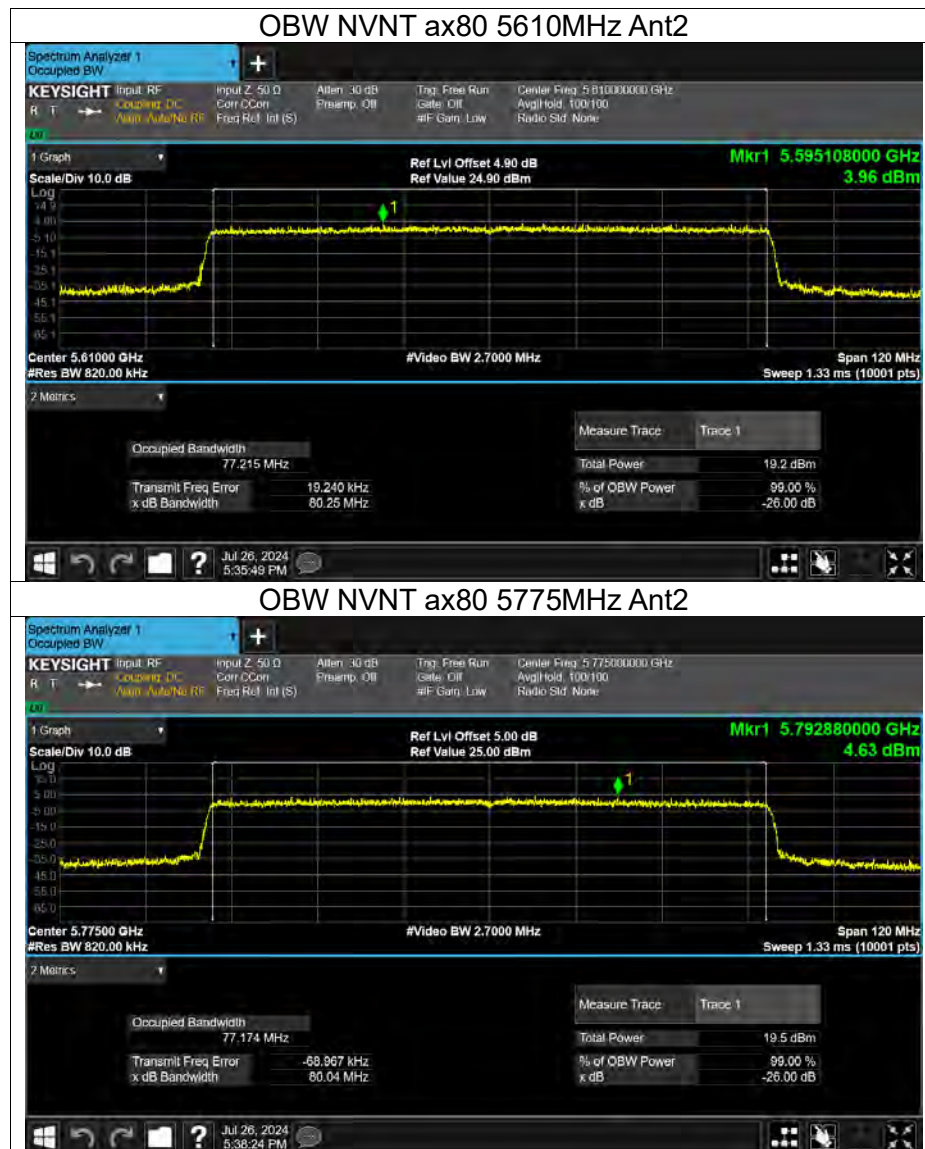



Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5180	Ant1	4.9	0	4.9	11	Pass
NVNT	a	5200	Ant1	5.09	0	5.09	11	Pass
NVNT	a	5240	Ant1	5.09	0	5.09	11	Pass
NVNT	a	5260	Ant1	5.33	0	5.33	11	Pass
NVNT	a	5300	Ant1	4.88	0	4.88	11	Pass
NVNT	a	5320	Ant1	5.32	0	5.32	11	Pass
NVNT	a	5500	Ant1	5.78	0	5.78	11	Pass
NVNT	a	5580	Ant1	5.58	0	5.58	11	Pass
NVNT	a	5700	Ant1	5.74	0	5.74	11	Pass
NVNT	a	5180	Ant2	7.42	0	7.42	11	Pass
NVNT	a	5200	Ant2	6.5	0	6.5	11	Pass
NVNT	a	5240	Ant2	7.19	0	7.19	11	Pass
NVNT	a	5260	Ant2	7.65	0	7.65	11	Pass
NVNT	a	5300	Ant2	7.04	0	7.04	11	Pass
NVNT	a	5320	Ant2	7.05	0	7.05	11	Pass
NVNT	a	5500	Ant2	6.56	0	6.56	11	Pass
NVNT	a	5580	Ant2	6.98	0	6.98	11	Pass
NVNT	a	5700	Ant2	6.38	0	6.38	11	Pass
NVNT	n20	5180	Ant1	2.42	0	2.42	11	Pass
NVNT	n20	5200	Ant1	2.58	0	2.58	11	Pass
NVNT	n20	5240	Ant1	3.73	0	3.73	11	Pass
NVNT	n20	5260	Ant1	4	0	4	11	Pass
NVNT	n20	5300	Ant1	3.16	0	3.16	11	Pass
NVNT	n20	5320	Ant1	3.53	0	3.53	11	Pass
NVNT	n20	5500	Ant1	3.59	0	3.59	11	Pass
NVNT	n20	5580	Ant1	3.68	0	3.68	11	Pass
NVNT	n20	5700	Ant1	3.66	0	3.66	11	Pass
NVNT	n20	5180	Ant2	5.47	0	5.47	11	Pass
NVNT	n20	5200	Ant2	4.22	0	4.22	11	Pass
NVNT	n20	5240	Ant2	4.79	0	4.79	11	Pass
NVNT	n20	5260	Ant2	5.36	0	5.36	11	Pass
NVNT	n20	5300	Ant2	4.88	0	4.88	11	Pass
NVNT	n20	5320	Ant2	5.12	0	5.12	11	Pass
NVNT	n20	5500	Ant2	5.04	0	5.04	11	Pass
NVNT	n20	5580	Ant2	4.13	0	4.13	11	Pass
NVNT	n20	5700	Ant2	3.98	0	3.98	11	Pass
NVNT	n20	5180	Ant1	1.42	0	1.42	11	Pass
NVNT	n20	5180	Ant2	1.33	0	1.33	11	Pass
NVNT	n20	5180	Sum	4.39	0	4.39	11	Pass
NVNT	n20	5200	Ant1	0.52	0	0.52	11	Pass
NVNT	n20	5200	Ant2	4.32	0	4.32	11	Pass
NVNT	n20	5200	Sum	5.83	0	5.83	11	Pass
NVNT	n20	5240	Ant1	1.97	0	1.97	11	Pass
NVNT	n20	5240	Ant2	2.22	0	2.22	11	Pass
NVNT	n20	5240	Sum	5.11	0	5.11	11	Pass
NVNT	n20	5260	Ant1	1.94	0	1.94	11	Pass
NVNT	n20	5260	Ant2	0.32	0	0.32	11	Pass
NVNT	n20	5260	Sum	4.22	0	4.22	11	Pass
NVNT	n20	5300	Ant1	-0.99	0	-0.99	11	Pass
NVNT	n20	5300	Ant2	1.82	0	1.82	11	Pass



NVNT	n20	5300	Sum	3.65	0	3.65	11	Pass
NVNT	n20	5320	Ant1	2.73	0	2.73	11	Pass
NVNT	n20	5320	Ant2	2.02	0	2.02	11	Pass
NVNT	n20	5320	Sum	5.4	0	5.4	11	Pass
NVNT	n20	5500	Ant1	1.65	0	1.65	11	Pass
NVNT	n20	5500	Ant2	0.81	0	0.81	11	Pass
NVNT	n20	5500	Sum	4.26	0	4.26	11	Pass
NVNT	n20	5580	Ant1	2.07	0	2.07	11	Pass
NVNT	n20	5580	Ant2	1.13	0	1.13	11	Pass
NVNT	n20	5580	Sum	4.64	0	4.64	11	Pass
NVNT	n20	5700	Ant1	2.32	0	2.32	11	Pass
NVNT	n20	5700	Ant2	1.09	0	1.09	11	Pass
NVNT	n20	5700	Sum	4.76	0	4.76	11	Pass
NVNT	n40	5190	Ant1	-0.88	0	-0.88	11	Pass
NVNT	n40	5230	Ant1	1.3	0	1.3	11	Pass
NVNT	n40	5270	Ant1	1.32	0	1.32	11	Pass
NVNT	n40	5310	Ant1	0.44	0	0.44	11	Pass
NVNT	n40	5510	Ant1	0.27	0	0.27	11	Pass
NVNT	n40	5550	Ant1	0.65	0	0.65	11	Pass
NVNT	n40	5670	Ant1	1.21	0	1.21	11	Pass
NVNT	n40	5190	Ant2	2.62	0	2.62	11	Pass
NVNT	n40	5230	Ant2	2.51	0	2.51	11	Pass
NVNT	n40	5270	Ant2	3.07	0	3.07	11	Pass
NVNT	n40	5310	Ant2	4.52	0	4.52	11	Pass
NVNT	n40	5510	Ant2	1.54	0	1.54	11	Pass
NVNT	n40	5550	Ant2	2.06	0	2.06	11	Pass
NVNT	n40	5670	Ant2	1.99	0	1.99	11	Pass
NVNT	n40	5190	Ant1	-1.47	0	-1.47	11	Pass
NVNT	n40	5190	Ant2	-0.36	0	-0.36	11	Pass
NVNT	n40	5190	Sum	2.13	0	2.13	11	Pass
NVNT	n40	5230	Ant1	-0.59	0	-0.59	11	Pass
NVNT	n40	5230	Ant2	0.65	0	0.65	11	Pass
NVNT	n40	5230	Sum	3.08	0	3.08	11	Pass
NVNT	n40	5270	Ant1	-1.49	0	-1.49	11	Pass
NVNT	n40	5270	Ant2	0	0	0	11	Pass
NVNT	n40	5270	Sum	2.33	0	2.33	11	Pass
NVNT	n40	5310	Ant1	-1.08	0	-1.08	11	Pass
NVNT	n40	5310	Ant2	-0.75	0	-0.75	11	Pass
NVNT	n40	5310	Sum	2.1	0	2.1	11	Pass
NVNT	n40	5510	Ant1	-3.6	0	-3.6	11	Pass
NVNT	n40	5510	Ant2	-1.76	0	-1.76	11	Pass
NVNT	n40	5510	Sum	0.43	0	0.43	11	Pass
NVNT	n40	5550	Ant1	0.51	0	0.51	11	Pass
NVNT	n40	5550	Ant2	-1.19	0	-1.19	11	Pass
NVNT	n40	5550	Sum	2.75	0	2.75	11	Pass
NVNT	n40	5670	Ant1	-0.65	0	-0.65	11	Pass
NVNT	n40	5670	Ant2	0.49	0	0.49	11	Pass
NVNT	n40	5670	Sum	2.97	0	2.97	11	Pass
NVNT	ac20	5180	Ant1	1.51	0	1.51	11	Pass
NVNT	ac20	5200	Ant1	1.33	0	1.33	11	Pass
NVNT	ac20	5240	Ant1	2.55	0	2.55	11	Pass
NVNT	ac20	5260	Ant1	2.78	0	2.78	11	Pass
NVNT	ac20	5300	Ant1	2.09	0	2.09	11	Pass
NVNT	ac20	5320	Ant1	1.93	0	1.93	11	Pass
NVNT	ac20	5500	Ant1	2.53	0	2.53	11	Pass
NVNT	ac20	5580	Ant1	2.7	0	2.7	11	Pass



NVNT	ac20	5700	Ant1	2.72	0	2.72	11	Pass
NVNT	ac20	5180	Ant2	3.35	0	3.35	11	Pass
NVNT	ac20	5200	Ant2	3.53	0	3.53	11	Pass
NVNT	ac20	5240	Ant2	3.98	0	3.98	11	Pass
NVNT	ac20	5260	Ant2	5.44	0	5.44	11	Pass
NVNT	ac20	5300	Ant2	3.86	0	3.86	11	Pass
NVNT	ac20	5320	Ant2	4.62	0	4.62	11	Pass
NVNT	ac20	5500	Ant2	4.3	0	4.3	11	Pass
NVNT	ac20	5580	Ant2	3.39	0	3.39	11	Pass
NVNT	ac20	5700	Ant2	2.83	0	2.83	11	Pass
NVNT	ac20	5180	Ant1	-3.06	0	-3.06	11	Pass
NVNT	ac20	5180	Ant2	1.26	0	1.26	11	Pass
NVNT	ac20	5180	Sum	2.63	0	2.63	11	Pass
NVNT	ac20	5200	Ant1	-1.16	0	-1.16	11	Pass
NVNT	ac20	5200	Ant2	1.27	0	1.27	11	Pass
NVNT	ac20	5200	Sum	3.23	0	3.23	11	Pass
NVNT	ac20	5240	Ant1	-0.5	0	-0.5	11	Pass
NVNT	ac20	5240	Ant2	-0.16	0	-0.16	11	Pass
NVNT	ac20	5240	Sum	2.68	0	2.68	11	Pass
NVNT	ac20	5260	Ant1	-2.31	0	-2.31	11	Pass
NVNT	ac20	5260	Ant2	2.48	0	2.48	11	Pass
NVNT	ac20	5260	Sum	3.72	0	3.72	11	Pass
NVNT	ac20	5300	Ant1	-1.45	0	-1.45	11	Pass
NVNT	ac20	5300	Ant2	1.26	0	1.26	11	Pass
NVNT	ac20	5300	Sum	3.12	0	3.12	11	Pass
NVNT	ac20	5320	Ant1	-1.01	0	-1.01	11	Pass
NVNT	ac20	5320	Ant2	1.69	0	1.69	11	Pass
NVNT	ac20	5320	Sum	3.56	0	3.56	11	Pass
NVNT	ac20	5500	Ant1	-1.31	0	-1.31	11	Pass
NVNT	ac20	5500	Ant2	1.64	0	1.64	11	Pass
NVNT	ac20	5500	Sum	3.42	0	3.42	11	Pass
NVNT	ac20	5580	Ant1	0.16	0	0.16	11	Pass
NVNT	ac20	5580	Ant2	1.6	0	1.6	11	Pass
NVNT	ac20	5580	Sum	3.95	0	3.95	11	Pass
NVNT	ac20	5700	Ant1	-1.89	0	-1.89	11	Pass
NVNT	ac20	5700	Ant2	0.52	0	0.52	11	Pass
NVNT	ac20	5700	Sum	2.49	0	2.49	11	Pass
NVNT	ac40	5190	Ant1	-0.37	0	-0.37	11	Pass
NVNT	ac40	5230	Ant1	0.17	0	0.17	11	Pass
NVNT	ac40	5270	Ant1	0.44	0	0.44	11	Pass
NVNT	ac40	5310	Ant1	-0.47	0	-0.47	11	Pass
NVNT	ac40	5510	Ant1	-0.56	0	-0.56	11	Pass
NVNT	ac40	5550	Ant1	-0.44	0	-0.44	11	Pass
NVNT	ac40	5670	Ant1	0.07	0	0.07	11	Pass
NVNT	ac40	5190	Ant2	1.7	0	1.7	11	Pass
NVNT	ac40	5230	Ant2	1.55	0	1.55	11	Pass
NVNT	ac40	5270	Ant2	1.89	0	1.89	11	Pass
NVNT	ac40	5310	Ant2	1.65	0	1.65	11	Pass
NVNT	ac40	5510	Ant2	0.32	0	0.32	11	Pass
NVNT	ac40	5550	Ant2	0.48	0	0.48	11	Pass
NVNT	ac40	5670	Ant2	0.85	0	0.85	11	Pass
NVNT	ac40	5190	Ant1	-4.15	0	-4.15	11	Pass
NVNT	ac40	5190	Ant2	-0.75	0	-0.75	11	Pass
NVNT	ac40	5190	Sum	0.88	0	0.88	11	Pass
NVNT	ac40	5230	Ant1	-0.05	0	-0.05	11	Pass
NVNT	ac40	5230	Ant2	-0.71	0	-0.71	11	Pass



NVNT	ac40	5230	Sum	2.64	0	2.64	11	Pass
NVNT	ac40	5270	Ant1	-4.77	0	-4.77	11	Pass
NVNT	ac40	5270	Ant2	-0.72	0	-0.72	11	Pass
NVNT	ac40	5270	Sum	0.72	0	0.72	11	Pass
NVNT	ac40	5310	Ant1	-3.86	0	-3.86	11	Pass
NVNT	ac40	5310	Ant2	-0.74	0	-0.74	11	Pass
NVNT	ac40	5310	Sum	0.98	0	0.98	11	Pass
NVNT	ac40	5510	Ant1	-3.59	0	-3.59	11	Pass
NVNT	ac40	5510	Ant2	-2.41	0	-2.41	11	Pass
NVNT	ac40	5510	Sum	0.05	0	0.05	11	Pass
NVNT	ac40	5550	Ant1	-2.9	0	-2.9	11	Pass
NVNT	ac40	5550	Ant2	-1.05	0	-1.05	11	Pass
NVNT	ac40	5550	Sum	1.13	0	1.13	11	Pass
NVNT	ac40	5670	Ant1	-2.78	0	-2.78	11	Pass
NVNT	ac40	5670	Ant2	-1.79	0	-1.79	11	Pass
NVNT	ac40	5670	Sum	0.75	0	0.75	11	Pass
NVNT	ac80	5210	Ant1	-5.2	0	-5.2	11	Pass
NVNT	ac80	5290	Ant1	-4.81	0	-4.81	11	Pass
NVNT	ac80	5530	Ant1	-5.2	0	-5.2	11	Pass
NVNT	ac80	5610	Ant1	-4.27	0	-4.27	11	Pass
NVNT	ac80	5210	Ant2	-3.44	0	-3.44	11	Pass
NVNT	ac80	5290	Ant2	-2.71	0	-2.71	11	Pass
NVNT	ac80	5530	Ant2	-3.61	0	-3.61	11	Pass
NVNT	ac80	5610	Ant2	-3.38	0	-3.38	11	Pass
NVNT	ac80	5210	Ant1	-7.69	0	-7.69	11	Pass
NVNT	ac80	5210	Ant2	-5.52	0	-5.52	11	Pass
NVNT	ac80	5210	Sum	-3.46	0	-3.46	11	Pass
NVNT	ac80	5290	Ant1	-8.62	0	-8.62	11	Pass
NVNT	ac80	5290	Ant2	-5.3	0	-5.3	11	Pass
NVNT	ac80	5290	Sum	-3.64	0	-3.64	11	Pass
NVNT	ac80	5530	Ant1	-6.28	0	-6.28	11	Pass
NVNT	ac80	5530	Ant2	-6.68	0	-6.68	11	Pass
NVNT	ac80	5530	Sum	-3.47	0	-3.47	11	Pass
NVNT	ac80	5610	Ant1	-6.95	0	-6.95	11	Pass
NVNT	ac80	5610	Ant2	-6.07	0	-6.07	11	Pass
NVNT	ac80	5610	Sum	-3.48	0	-3.48	11	Pass
NVNT	ax20	5180	Ant1	0.45	0	0.45	11	Pass
NVNT	ax20	5200	Ant1	0.29	0	0.29	11	Pass
NVNT	ax20	5240	Ant1	1.17	0	1.17	11	Pass
NVNT	ax20	5260	Ant1	1.59	0	1.59	11	Pass
NVNT	ax20	5300	Ant1	1.01	0	1.01	11	Pass
NVNT	ax20	5320	Ant1	1.01	0	1.01	11	Pass
NVNT	ax20	5500	Ant1	1.4	0	1.4	11	Pass
NVNT	ax20	5580	Ant1	1.54	0	1.54	11	Pass
NVNT	ax20	5700	Ant1	1.33	0	1.33	11	Pass
NVNT	ax20	5180	Ant2	1.91	0	1.91	11	Pass
NVNT	ax20	5200	Ant2	2.35	0	2.35	11	Pass
NVNT	ax20	5240	Ant2	2.9	0	2.9	11	Pass
NVNT	ax20	5260	Ant2	3.25	0	3.25	11	Pass
NVNT	ax20	5300	Ant2	2.41	0	2.41	11	Pass
NVNT	ax20	5320	Ant2	2.81	0	2.81	11	Pass
NVNT	ax20	5500	Ant2	2.22	0	2.22	11	Pass
NVNT	ax20	5580	Ant2	2.3	0	2.3	11	Pass
NVNT	ax20	5700	Ant2	1.91	0	1.91	11	Pass
NVNT	ax20	5180	Ant1	-4.47	0	-4.47	11	Pass
NVNT	ax20	5180	Ant2	0.22	0	0.22	11	Pass



NVNT	ax20	5180	Sum	1.49	0	1.49	11	Pass
NVNT	ax20	5200	Ant1	-2.18	0	-2.18	11	Pass
NVNT	ax20	5200	Ant2	0.03	0	0.03	11	Pass
NVNT	ax20	5200	Sum	2.07	0	2.07	11	Pass
NVNT	ax20	5240	Ant1	-0.56	0	-0.56	11	Pass
NVNT	ax20	5240	Ant2	0.68	0	0.68	11	Pass
NVNT	ax20	5240	Sum	3.11	0	3.11	11	Pass
NVNT	ax20	5260	Ant1	-3.45	0	-3.45	11	Pass
NVNT	ax20	5260	Ant2	0.9	0	0.9	11	Pass
NVNT	ax20	5260	Sum	2.26	0	2.26	11	Pass
NVNT	ax20	5300	Ant1	-2.67	0	-2.67	11	Pass
NVNT	ax20	5300	Ant2	0.12	0	0.12	11	Pass
NVNT	ax20	5300	Sum	1.96	0	1.96	11	Pass
NVNT	ax20	5320	Ant1	0.64	0	0.64	11	Pass
NVNT	ax20	5320	Ant2	0.19	0	0.19	11	Pass
NVNT	ax20	5320	Sum	3.43	0	3.43	11	Pass
NVNT	ax20	5500	Ant1	-2.23	0	-2.23	11	Pass
NVNT	ax20	5500	Ant2	0.11	0	0.11	11	Pass
NVNT	ax20	5500	Sum	2.11	0	2.11	11	Pass
NVNT	ax20	5580	Ant1	2.23	0	2.23	11	Pass
NVNT	ax20	5580	Ant2	0.09	0	0.09	11	Pass
NVNT	ax20	5580	Sum	4.3	0	4.3	11	Pass
NVNT	ax20	5700	Ant1	0.95	0	0.95	11	Pass
NVNT	ax20	5700	Ant2	-0.5	0	-0.5	11	Pass
NVNT	ax20	5700	Sum	3.3	0	3.3	11	Pass
NVNT	ax40	5190	Ant1	-1.34	0	-1.34	11	Pass
NVNT	ax40	5230	Ant1	-0.81	0	-0.81	11	Pass
NVNT	ax40	5270	Ant1	-0.84	0	-0.84	11	Pass
NVNT	ax40	5310	Ant1	-1.53	0	-1.53	11	Pass
NVNT	ax40	5510	Ant1	-1.49	0	-1.49	11	Pass
NVNT	ax40	5550	Ant1	-1.19	0	-1.19	11	Pass
NVNT	ax40	5670	Ant1	-0.5	0	-0.5	11	Pass
NVNT	ax40	5190	Ant2	0.87	0	0.87	11	Pass
NVNT	ax40	5230	Ant2	0.72	0	0.72	11	Pass
NVNT	ax40	5270	Ant2	3.11	0	3.11	11	Pass
NVNT	ax40	5310	Ant2	0.85	0	0.85	11	Pass
NVNT	ax40	5510	Ant2	-0.24	0	-0.24	11	Pass
NVNT	ax40	5550	Ant2	-0.27	0	-0.27	11	Pass
NVNT	ax40	5670	Ant2	1.6	0	1.6	11	Pass
NVNT	ax40	5190	Ant1	-5.4	0	-5.4	11	Pass
NVNT	ax40	5190	Ant2	-2.03	0	-2.03	11	Pass
NVNT	ax40	5190	Sum	-0.39	0	-0.39	11	Pass
NVNT	ax40	5230	Ant1	-2.32	0	-2.32	11	Pass
NVNT	ax40	5230	Ant2	-1.31	0	-1.31	11	Pass
NVNT	ax40	5230	Sum	1.22	0	1.22	11	Pass
NVNT	ax40	5270	Ant1	-4.49	0	-4.49	11	Pass
NVNT	ax40	5270	Ant2	-0.47	0	-0.47	11	Pass
NVNT	ax40	5270	Sum	0.98	0	0.98	11	Pass
NVNT	ax40	5310	Ant1	-3.51	0	-3.51	11	Pass
NVNT	ax40	5310	Ant2	-0.85	0	-0.85	11	Pass
NVNT	ax40	5310	Sum	1.03	0	1.03	11	Pass
NVNT	ax40	5510	Ant1	-3.38	0	-3.38	11	Pass
NVNT	ax40	5510	Ant2	-0.61	0	-0.61	11	Pass
NVNT	ax40	5510	Sum	1.23	0	1.23	11	Pass
NVNT	ax40	5550	Ant1	-3.82	0	-3.82	11	Pass
NVNT	ax40	5550	Ant2	-2.29	0	-2.29	11	Pass




NVNT	ax40	5550	Sum	0.02	0	0.02	11	Pass
NVNT	ax40	5670	Ant1	-2.7	0	-2.7	11	Pass
NVNT	ax40	5670	Ant2	-2.12	0	-2.12	11	Pass
NVNT	ax40	5670	Sum	0.61	0	0.61	11	Pass
NVNT	ax80	5210	Ant1	-5.95	0	-5.95	11	Pass
NVNT	ax80	5290	Ant1	-5.92	0	-5.92	11	Pass
NVNT	ax80	5530	Ant1	-5.72	0	-5.72	11	Pass
NVNT	ax80	5610	Ant1	-5.3	0	-5.3	11	Pass
NVNT	ax80	5210	Ant2	-3.83	0	-3.83	11	Pass
NVNT	ax80	5290	Ant2	-3.66	0	-3.66	11	Pass
NVNT	ax80	5530	Ant2	-4.57	0	-4.57	11	Pass
NVNT	ax80	5610	Ant2	-4.37	0	-4.37	11	Pass
NVNT	ax80	5210	Ant1	-6.73	0	-6.73	11	Pass
NVNT	ax80	5210	Ant2	-6.34	0	-6.34	11	Pass
NVNT	ax80	5210	Sum	-3.52	0	-3.52	11	Pass
NVNT	ax80	5290	Ant1	-9.25	0	-9.25	11	Pass
NVNT	ax80	5290	Ant2	-5.81	0	-5.81	11	Pass
NVNT	ax80	5290	Sum	-4.19	0	-4.19	11	Pass
NVNT	ax80	5530	Ant1	-6.61	0	-6.61	11	Pass
NVNT	ax80	5530	Ant2	-6.99	0	-6.99	11	Pass
NVNT	ax80	5530	Sum	-3.79	0	-3.79	11	Pass
NVNT	ax80	5610	Ant1	-8.14	0	-8.14	11	Pass
NVNT	ax80	5610	Ant2	-6.99	0	-6.99	11	Pass
NVNT	ax80	5610	Sum	-4.52	0	-4.52	11	Pass
Condi tion	Mod e	Frequen cy (MHz)	Anten na	Conducted PSD (dBm/500k Hz)	Duty Fact or (dB)	Total PSD (dBm/500k Hz)	Limit (dBm/500k Hz)	Verdi ct
NVNT	a	5745	Ant1	2.94	0	2.94	30	Pass
NVNT	a	5785	Ant1	2.26	0	2.26	30	Pass
NVNT	a	5825	Ant1	2.92	0	2.92	30	Pass
NVNT	a	5745	Ant2	3.68	0	3.68	30	Pass
NVNT	a	5785	Ant2	3.74	0	3.74	30	Pass
NVNT	a	5825	Ant2	3.96	0	3.96	30	Pass
NVNT	n20	5745	Ant1	0.75	0	0.75	30	Pass
NVNT	n20	5785	Ant1	0.89	0	0.89	30	Pass
NVNT	n20	5825	Ant1	0.8	0	0.8	30	Pass
NVNT	n20	5745	Ant2	1	0	1	30	Pass
NVNT	n20	5785	Ant2	0.93	0	0.93	30	Pass
NVNT	n20	5825	Ant2	1.11	0	1.11	30	Pass
NVNT	n20	5745	Ant1	-2.41	0	-2.41	30	Pass
NVNT	n20	5745	Ant2	-1.73	0	-1.73	30	Pass
NVNT	n20	5745	Sum	0.95	0	0.95	30	Pass
NVNT	n20	5785	Ant1	-0.93	0	-0.93	30	Pass
NVNT	n20	5785	Ant2	0.37	0	0.37	30	Pass
NVNT	n20	5785	Sum	2.78	0	2.78	30	Pass
NVNT	n20	5825	Ant1	-1.82	0	-1.82	30	Pass
NVNT	n20	5825	Ant2	-1.58	0	-1.58	30	Pass
NVNT	n20	5825	Sum	1.31	0	1.31	30	Pass
NVNT	n40	5755	Ant1	-2.04	0	-2.04	30	Pass
NVNT	n40	5795	Ant1	-1.72	0	-1.72	30	Pass
NVNT	n40	5755	Ant2	-1.21	0	-1.21	30	Pass
NVNT	n40	5795	Ant2	-1.03	0	-1.03	30	Pass
NVNT	n40	5755	Ant1	-4.17	0	-4.17	30	Pass
NVNT	n40	5755	Ant2	-4.36	0	-4.36	30	Pass
NVNT	n40	5755	Sum	-1.25	0	-1.25	30	Pass





NVNT	n40	5795	Ant1	-1.76	0	-1.76	30	Pass
NVNT	n40	5795	Ant2	-4.07	0	-4.07	30	Pass
NVNT	n40	5795	Sum	0.25	0	0.25	30	Pass
NVNT	ac20	5745	Ant1	-0.15	0	-0.15	30	Pass
NVNT	ac20	5785	Ant1	0.11	0	0.11	30	Pass
NVNT	ac20	5825	Ant1	-0.17	0	-0.17	30	Pass
NVNT	ac20	5745	Ant2	0.09	0	0.09	30	Pass
NVNT	ac20	5785	Ant2	0.13	0	0.13	30	Pass
NVNT	ac20	5825	Ant2	0.41	0	0.41	30	Pass
NVNT	ac20	5745	Ant1	-3.56	0	-3.56	30	Pass
NVNT	ac20	5745	Ant2	-2.44	0	-2.44	30	Pass
NVNT	ac20	5745	Sum	0.05	0	0.05	30	Pass
NVNT	ac20	5785	Ant1	-4.05	0	-4.05	30	Pass
NVNT	ac20	5785	Ant2	-3.61	0	-3.61	30	Pass
NVNT	ac20	5785	Sum	-0.81	0	-0.81	30	Pass
NVNT	ac20	5825	Ant1	-4.35	0	-4.35	30	Pass
NVNT	ac20	5825	Ant2	-2.29	0	-2.29	30	Pass
NVNT	ac20	5825	Sum	-0.19	0	-0.19	30	Pass
NVNT	ac40	5755	Ant1	-3.04	0	-3.04	30	Pass
NVNT	ac40	5795	Ant1	-2.65	0	-2.65	30	Pass
NVNT	ac40	5755	Ant2	-2.09	0	-2.09	30	Pass
NVNT	ac40	5795	Ant2	-2.37	0	-2.37	30	Pass
NVNT	ac40	5755	Ant1	-5.83	0	-5.83	30	Pass
NVNT	ac40	5755	Ant2	-2.7	0	-2.7	30	Pass
NVNT	ac40	5755	Sum	-0.98	0	-0.98	30	Pass
NVNT	ac40	5795	Ant1	-5.65	0	-5.65	30	Pass
NVNT	ac40	5795	Ant2	-4.06	0	-4.06	30	Pass
NVNT	ac40	5795	Sum	-1.77	0	-1.77	30	Pass
NVNT	ac80	5775	Ant1	-6.96	0	-6.96	30	Pass
NVNT	ac80	5775	Ant2	-6.71	0	-6.71	30	Pass
NVNT	ac80	5775	Ant1	-8.72	0	-8.72	30	Pass
NVNT	ac80	5775	Ant2	-8.45	0	-8.45	30	Pass
NVNT	ac80	5775	Sum	-5.57	0	-5.57	30	Pass
NVNT	ax20	5745	Ant1	-1.4	0	-1.4	30	Pass
NVNT	ax20	5785	Ant1	-1.24	0	-1.24	30	Pass
NVNT	ax20	5825	Ant1	-3.6	0	-3.6	30	Pass
NVNT	ax20	5745	Ant2	-1.2	0	-1.2	30	Pass
NVNT	ax20	5785	Ant2	-0.6	0	-0.6	30	Pass
NVNT	ax20	5825	Ant2	-0.75	0	-0.75	30	Pass
NVNT	ax20	5745	Ant1	-4.58	0	-4.58	30	Pass
NVNT	ax20	5745	Ant2	-3.71	0	-3.71	30	Pass
NVNT	ax20	5745	Sum	-1.11	0	-1.11	30	Pass
NVNT	ax20	5785	Ant1	-0.94	0	-0.94	30	Pass
NVNT	ax20	5785	Ant2	-3.19	0	-3.19	30	Pass
NVNT	ax20	5785	Sum	1.09	0	1.09	30	Pass
NVNT	ax20	5825	Ant1	-3.82	0	-3.82	30	Pass
NVNT	ax20	5825	Ant2	-2.92	0	-2.92	30	Pass
NVNT	ax20	5825	Sum	-0.34	0	-0.34	30	Pass
NVNT	ax40	5755	Ant1	-3.64	0	-3.64	30	Pass
NVNT	ax40	5795	Ant1	-3.62	0	-3.62	30	Pass
NVNT	ax40	5755	Ant2	-3.24	0	-3.24	30	Pass
NVNT	ax40	5795	Ant2	-3	0	-3	30	Pass
NVNT	ax40	5755	Ant1	-4.78	0	-4.78	30	Pass
NVNT	ax40	5755	Ant2	-5.57	0	-5.57	30	Pass
NVNT	ax40	5755	Sum	-2.15	0	-2.15	30	Pass
NVNT	ax40	5795	Ant1	-6.98	0	-6.98	30	Pass



NVNT	ax40	5795	Ant2	-5.24	0	-5.24	30	Pass
NVNT	ax40	5795	Sum	-3.01	0	-3.01	30	Pass
NVNT	ax80	5775	Ant1	-7.79	0	-7.79	30	Pass
NVNT	ax80	5775	Ant2	-7.31	0	-7.31	30	Pass
NVNT	ax80	5775	Ant1	-9.3	0	-9.3	30	Pass
NVNT	ax80	5775	Ant2	-9.82	0	-9.82	30	Pass
NVNT	ax80	5775	Sum	-6.54	0	-6.54	30	Pass

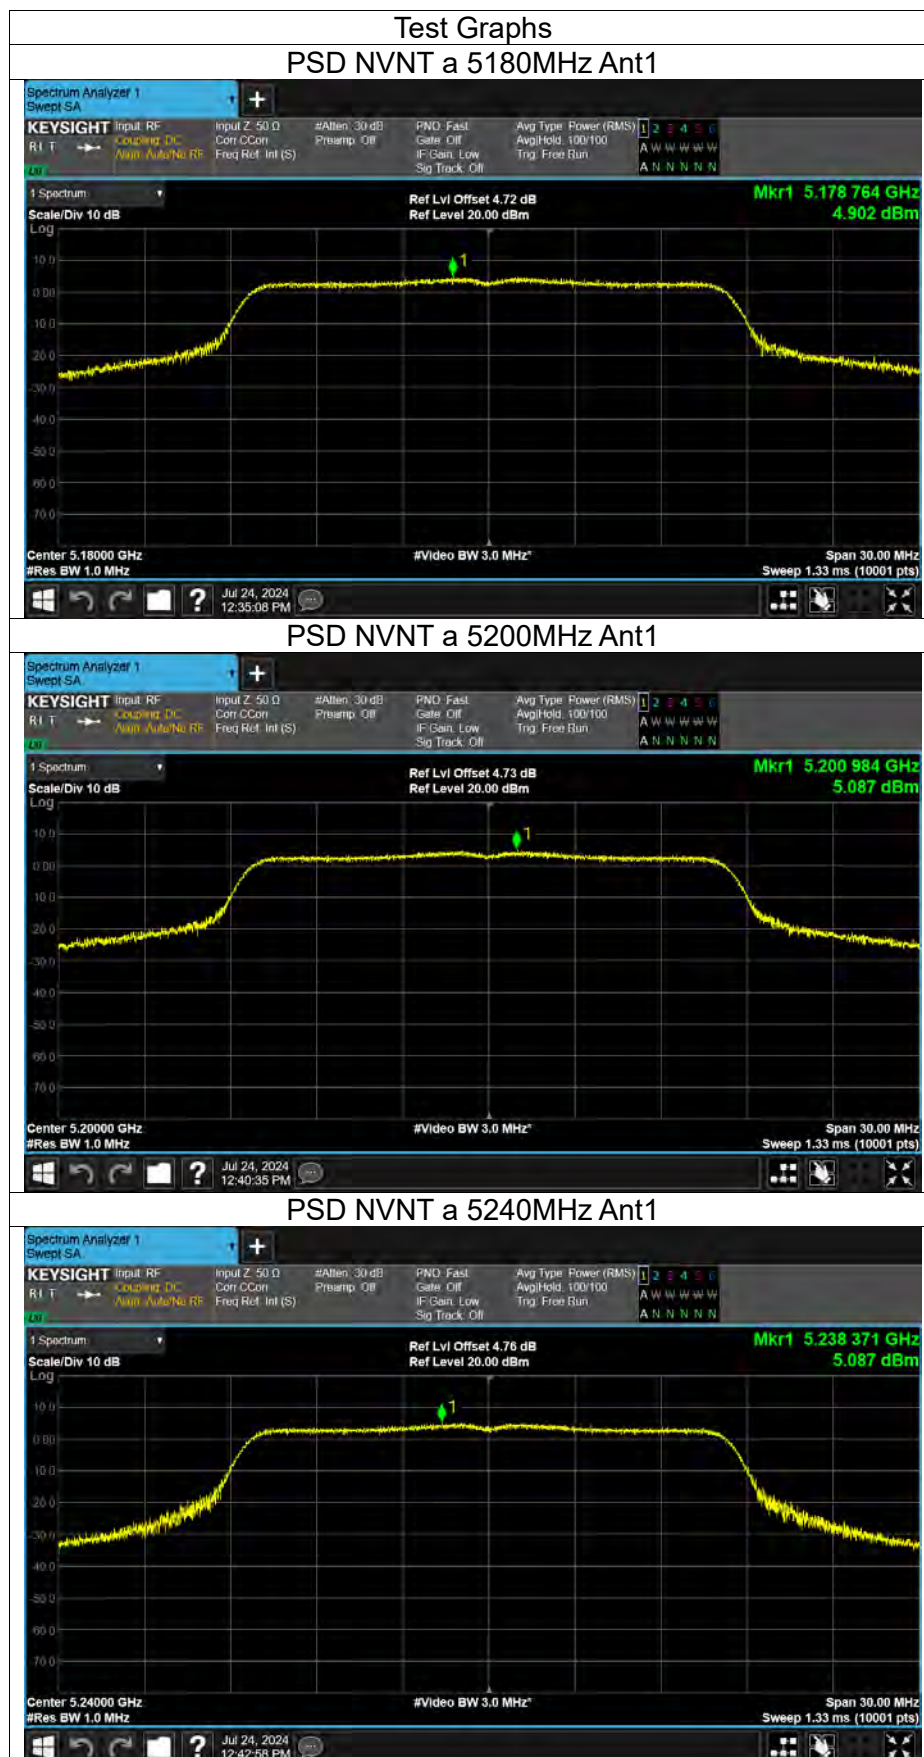

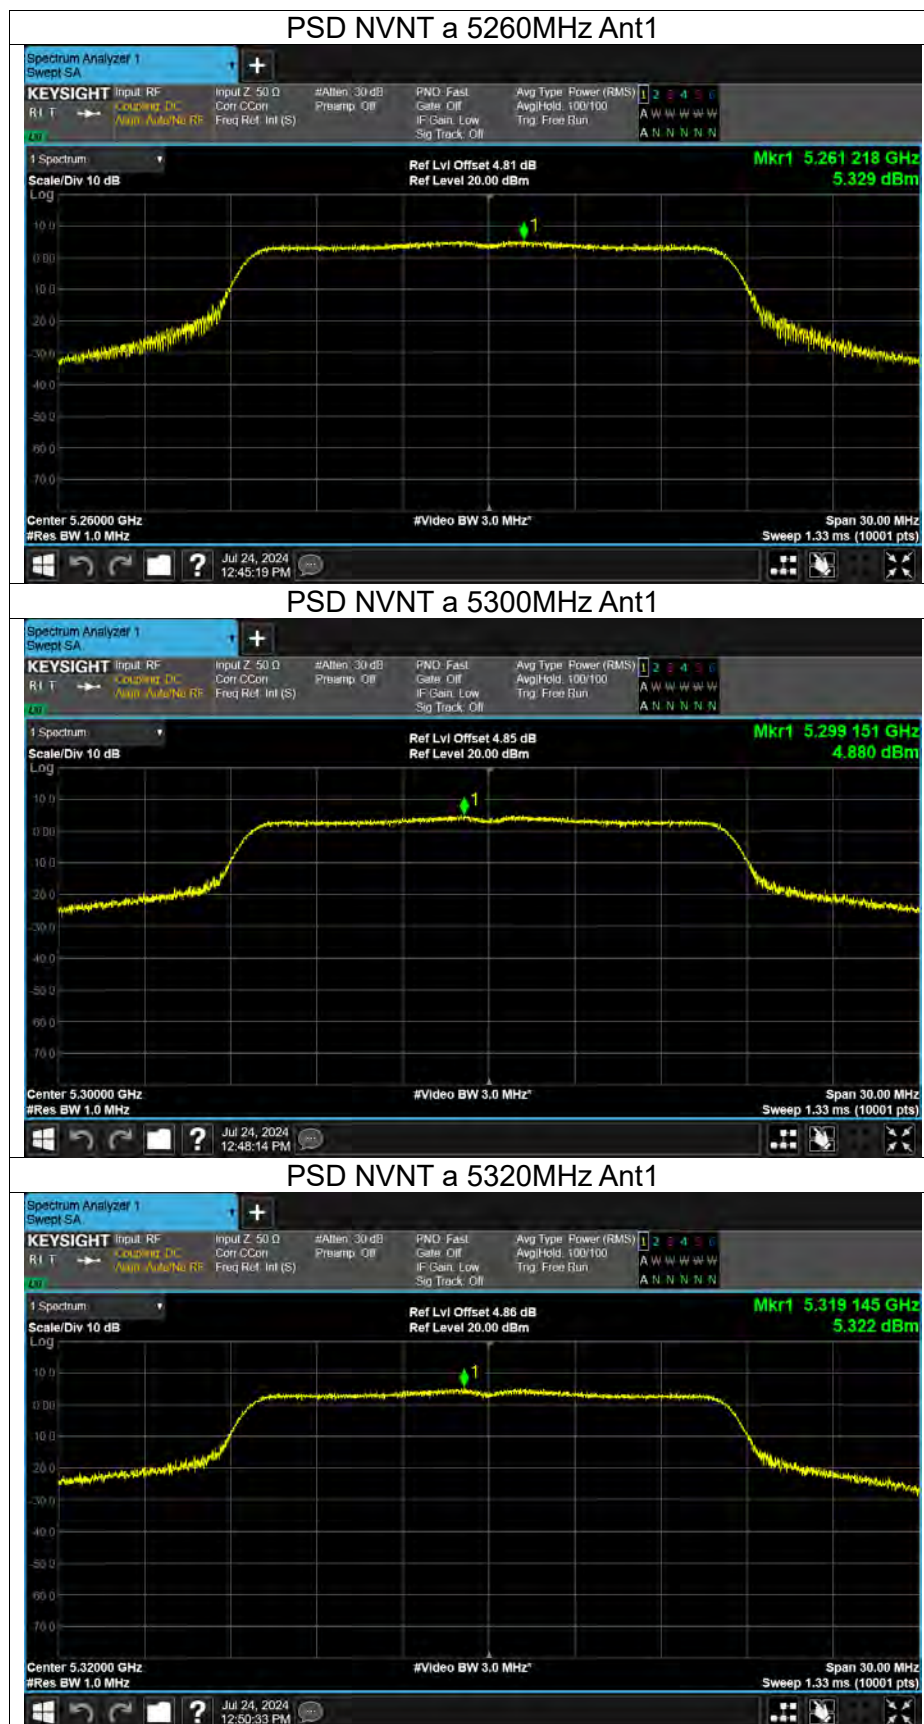

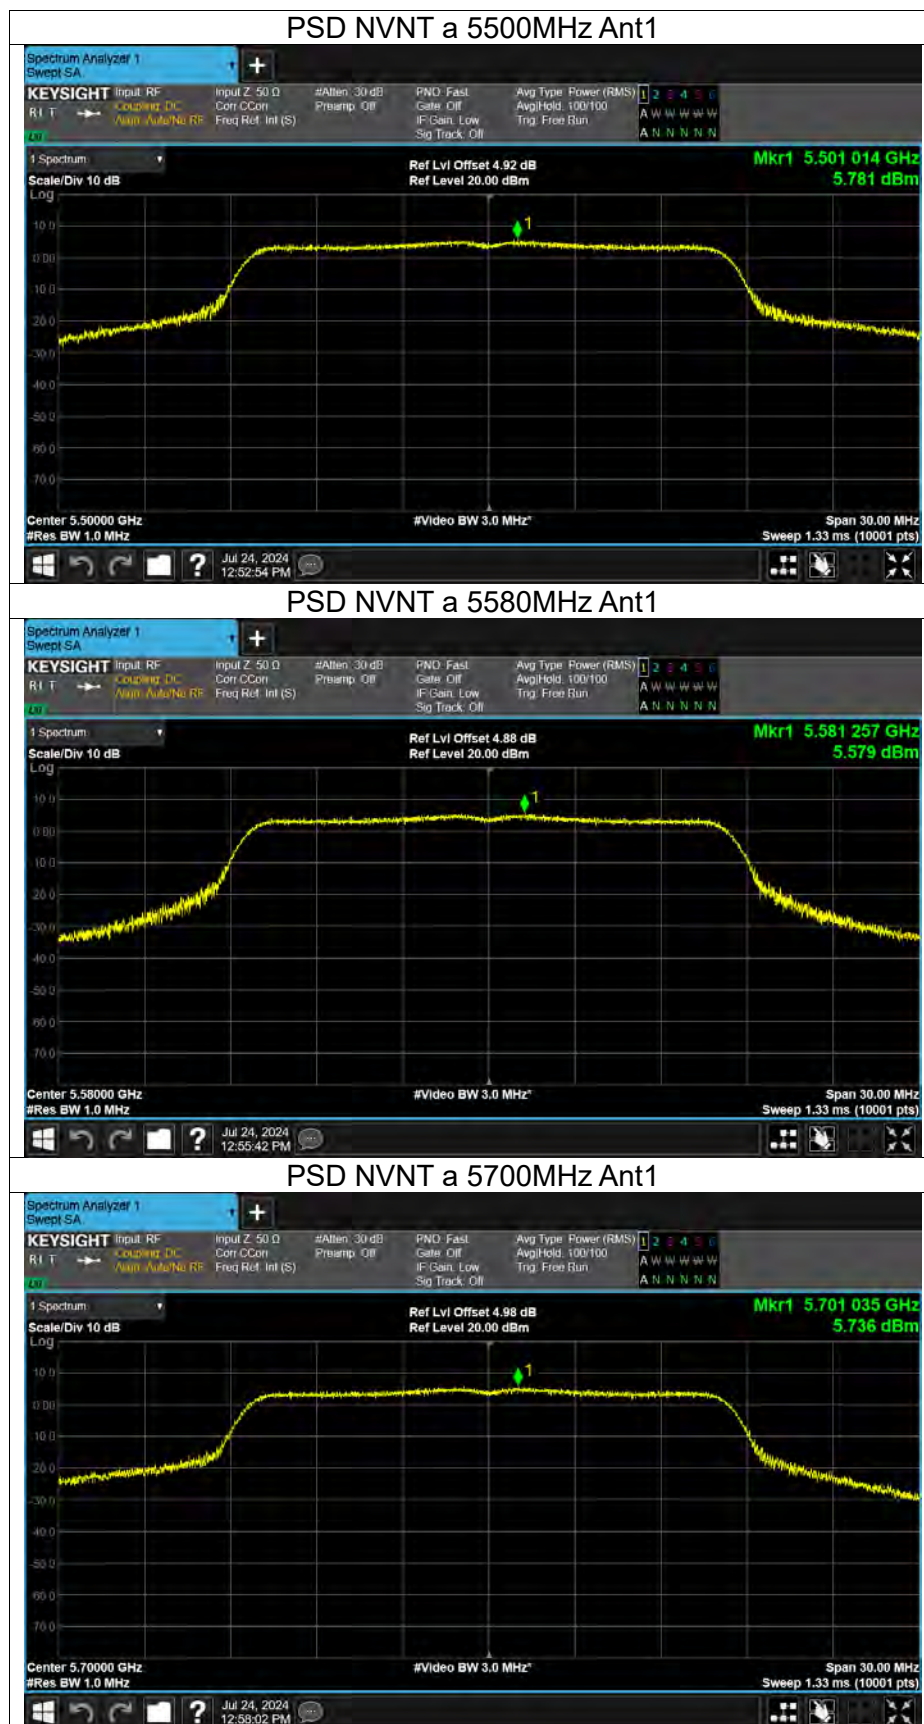



PSD NVNT a 5180MHz Ant2



PSD NVNT a 5200MHz Ant2



PSD NVNT a 5240MHz Ant2





PSD NVNT a 5260MHz Ant2



PSD NVNT a 5300MHz Ant2



PSD NVNT a 5320MHz Ant2





PSD NVNT a 5500MHz Ant2



PSD NVNT a 5580MHz Ant2



PSD NVNT a 5700MHz Ant2



