






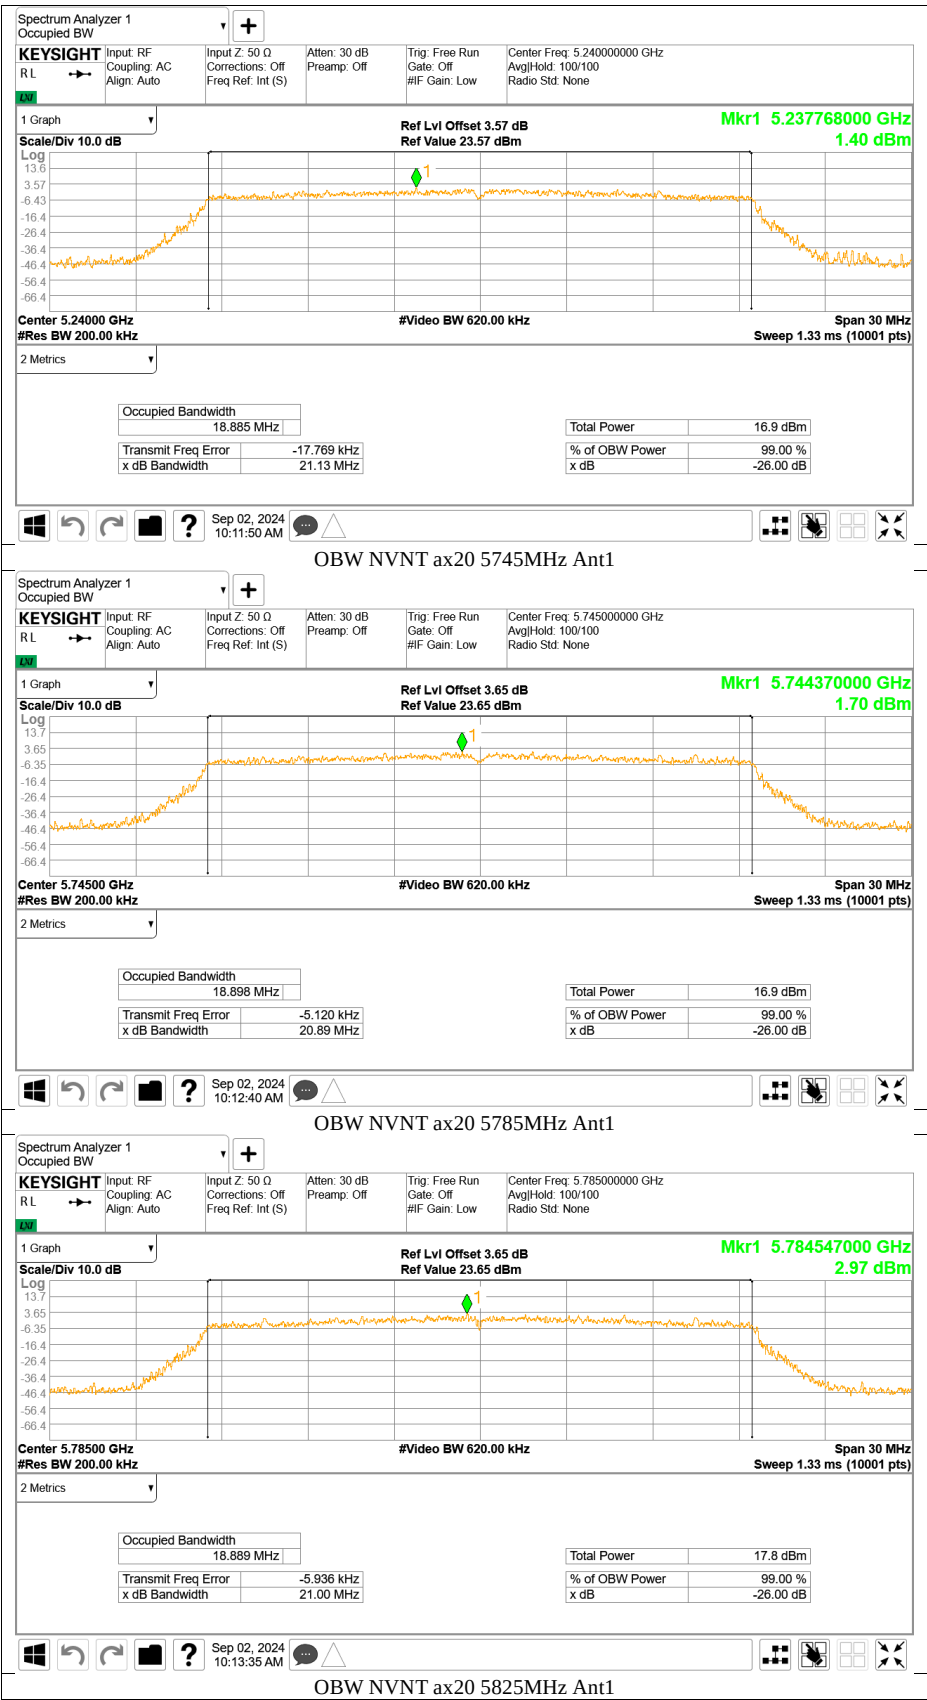


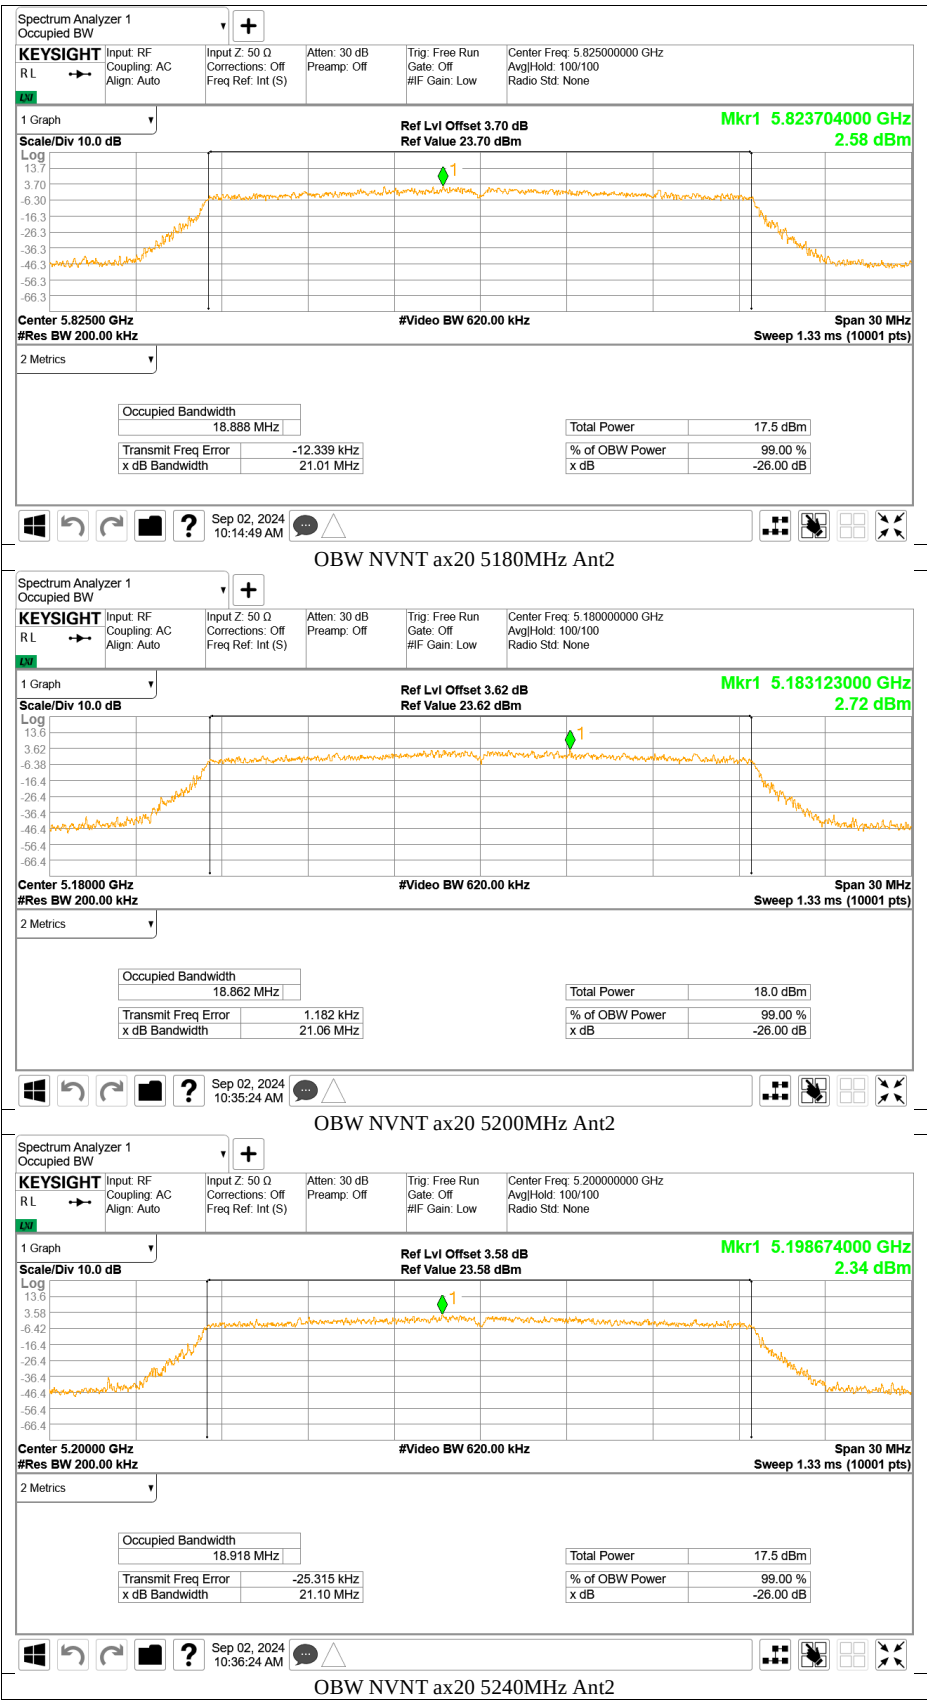


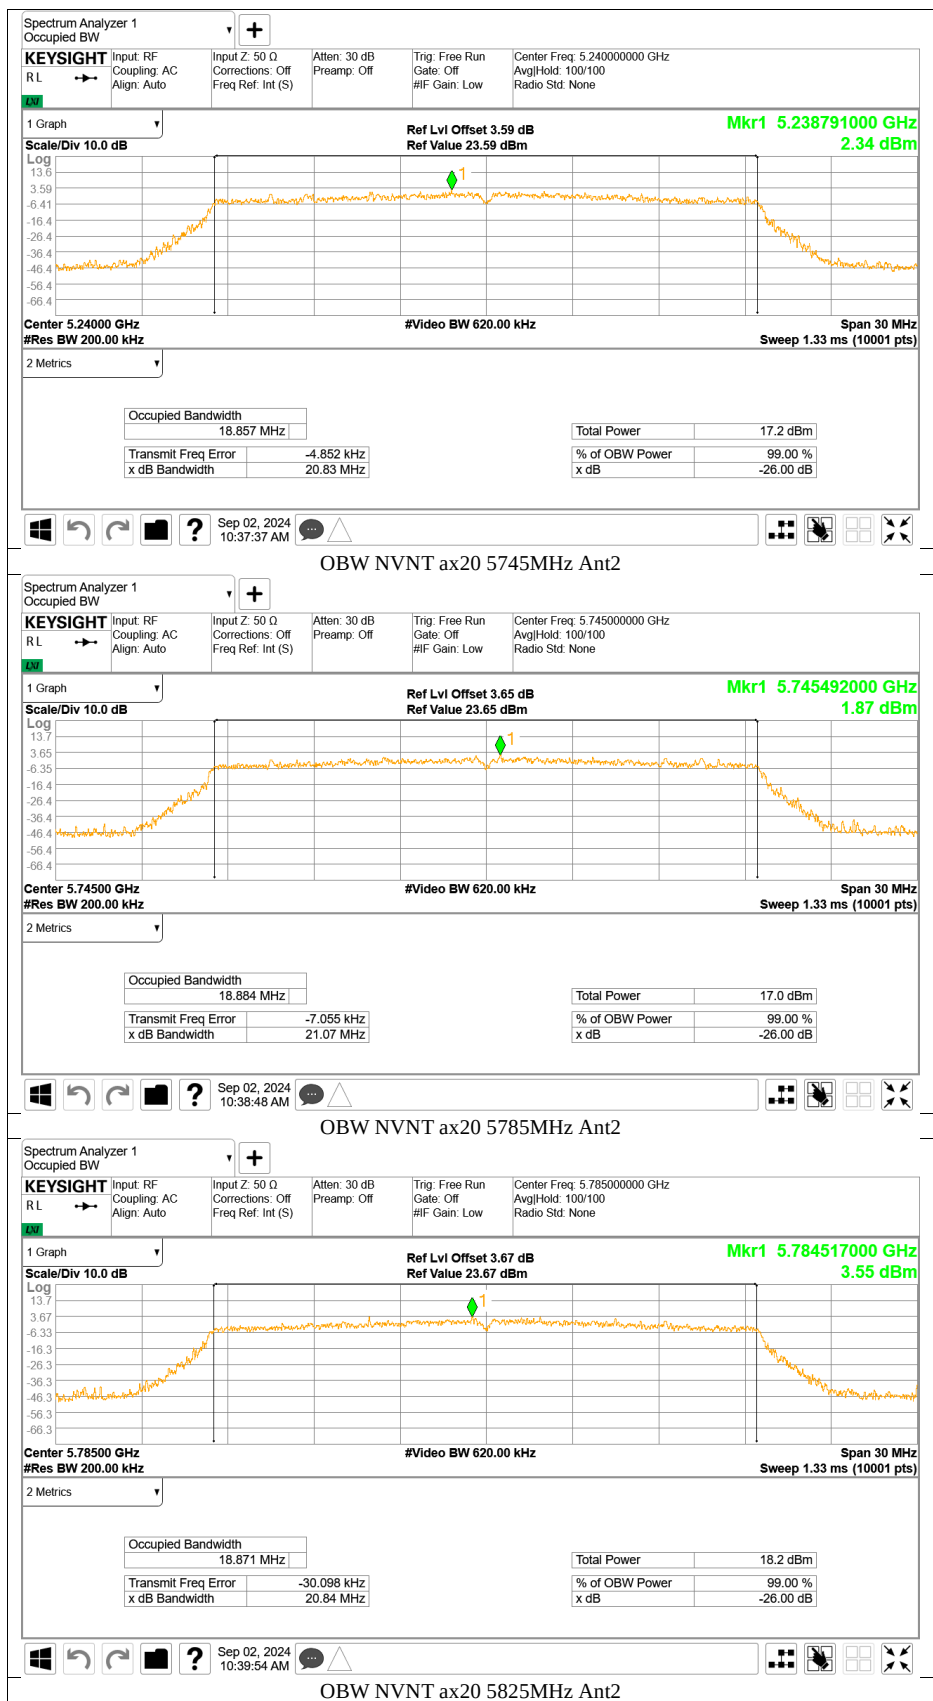


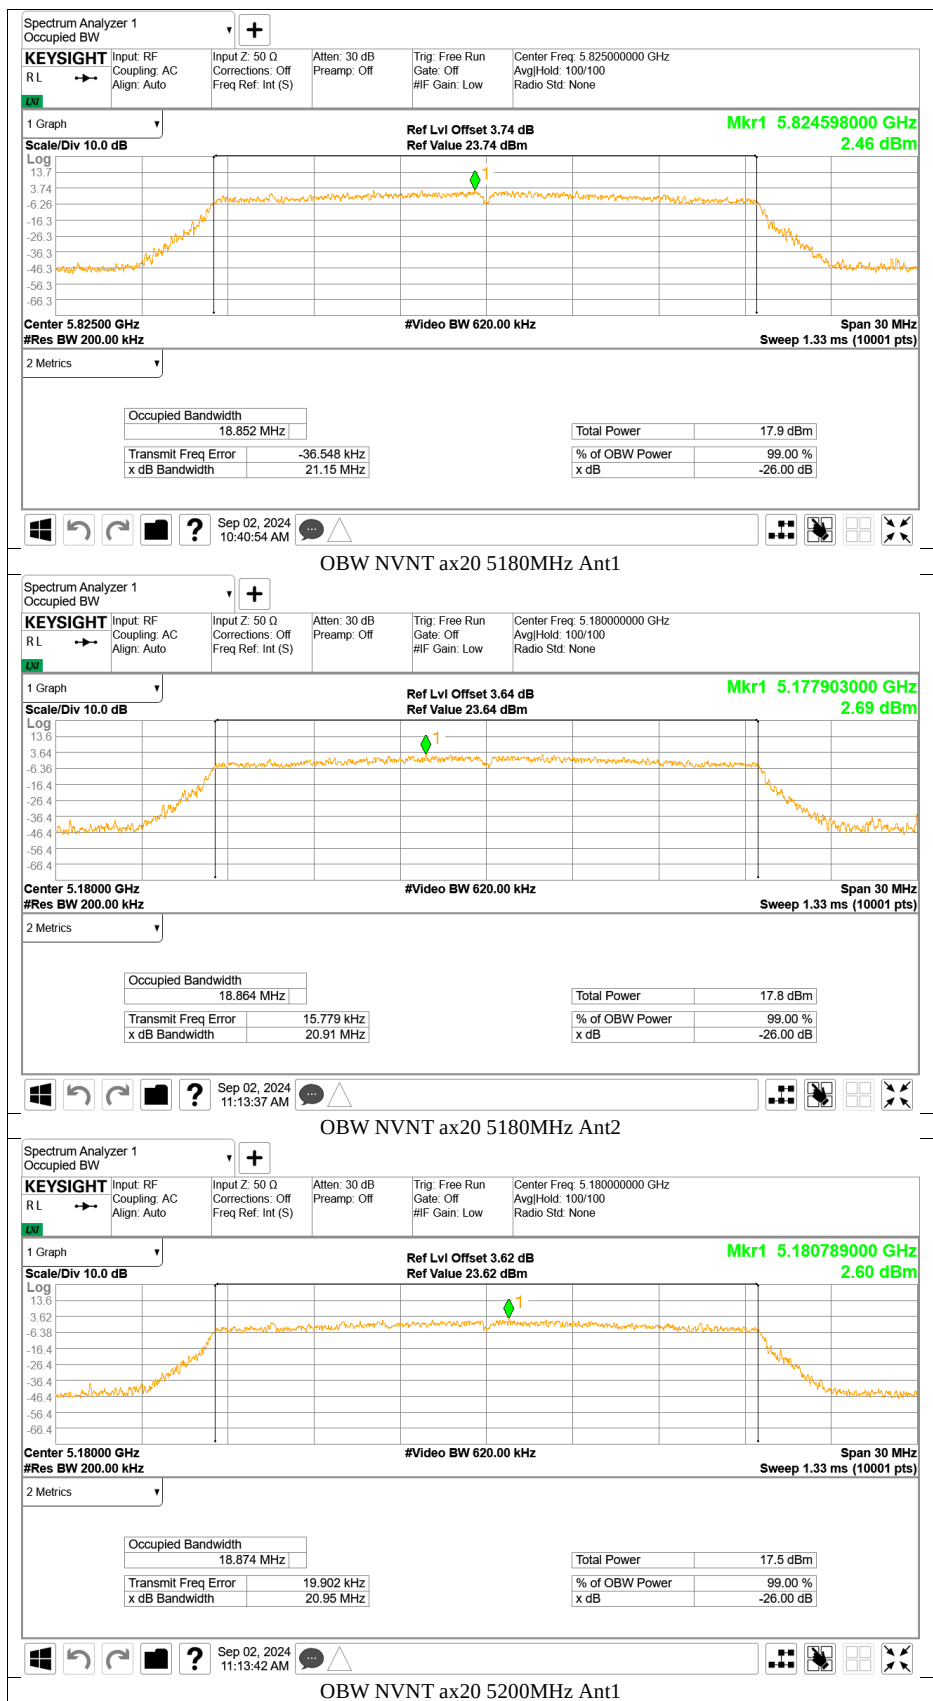


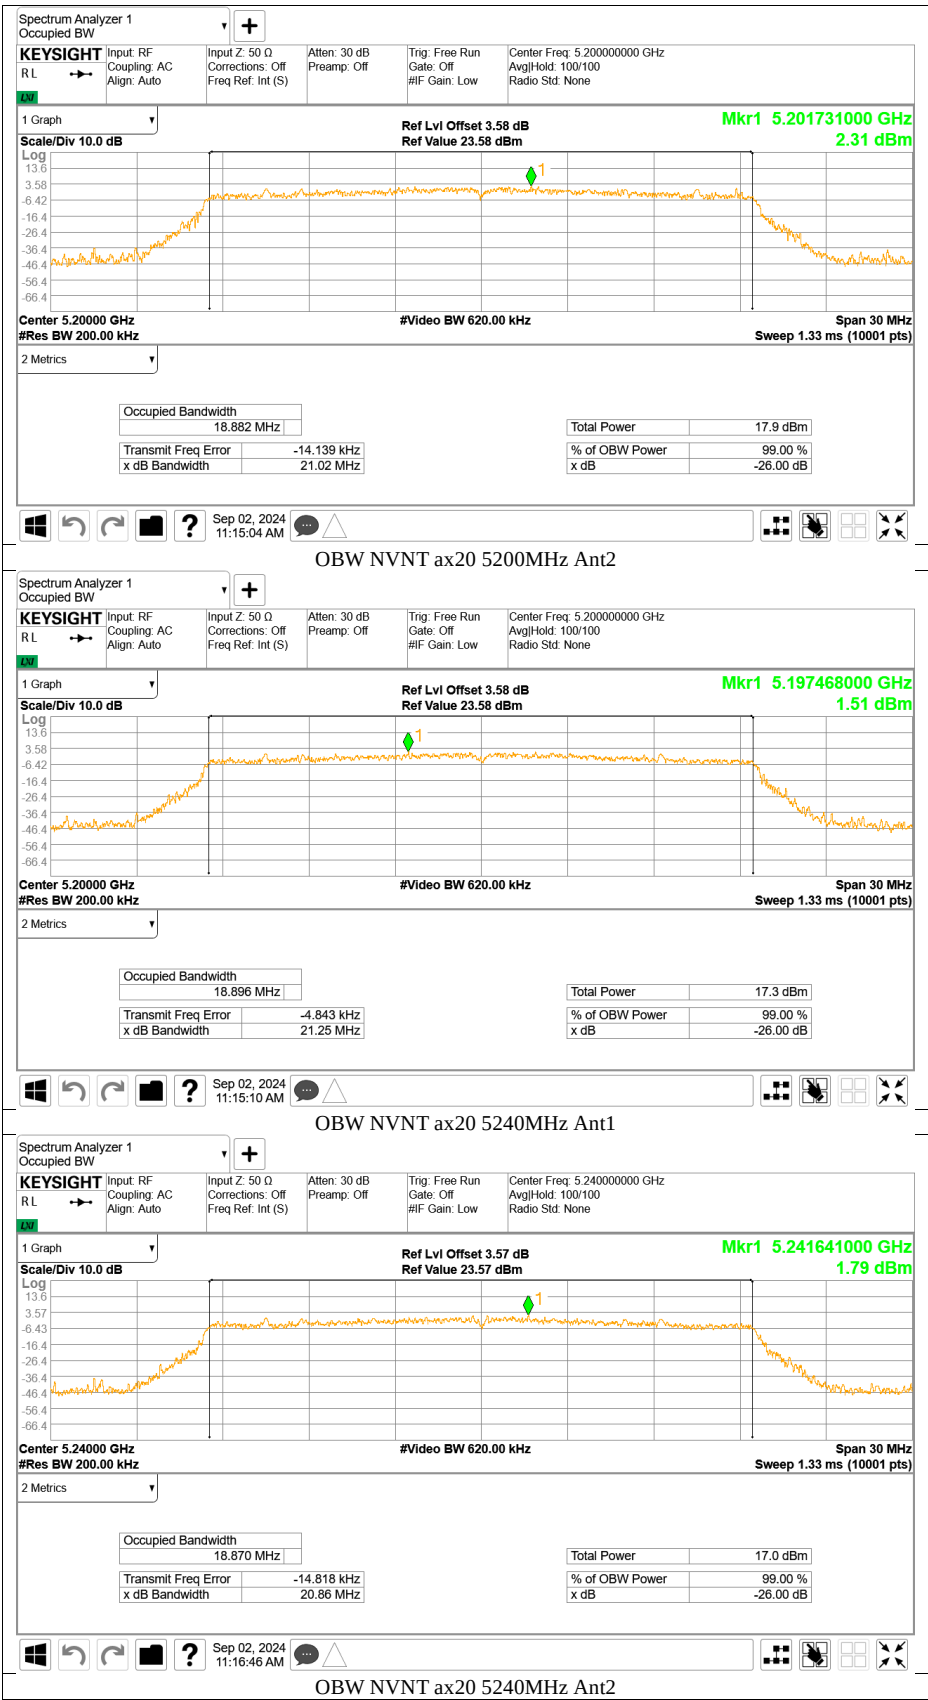


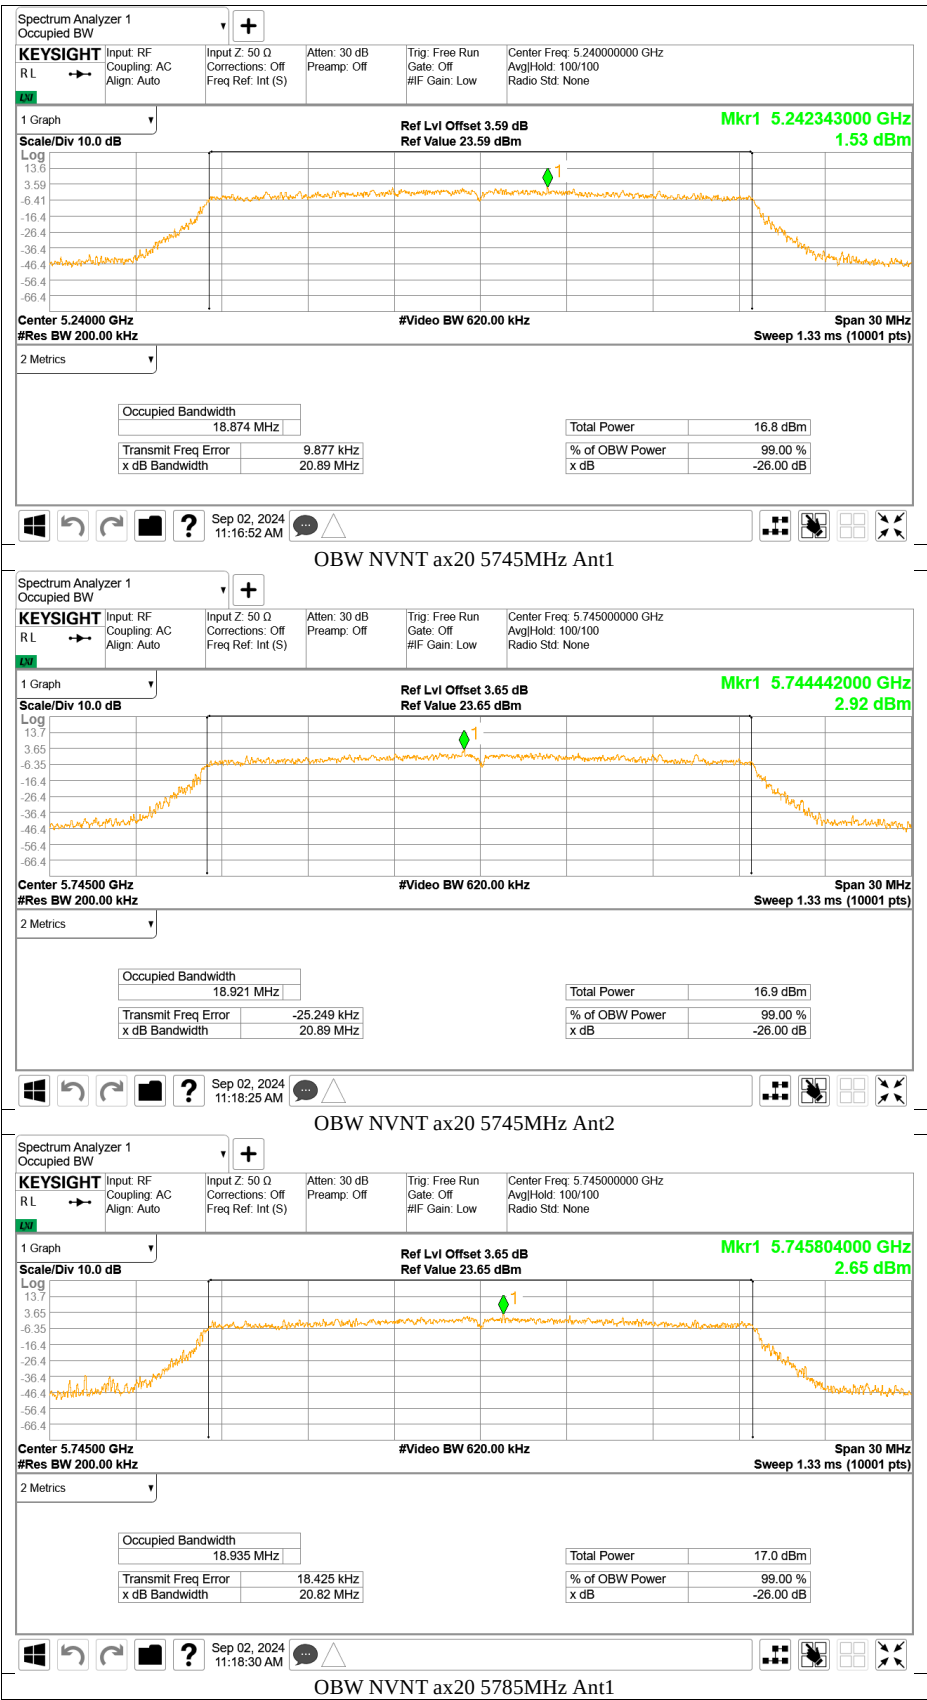


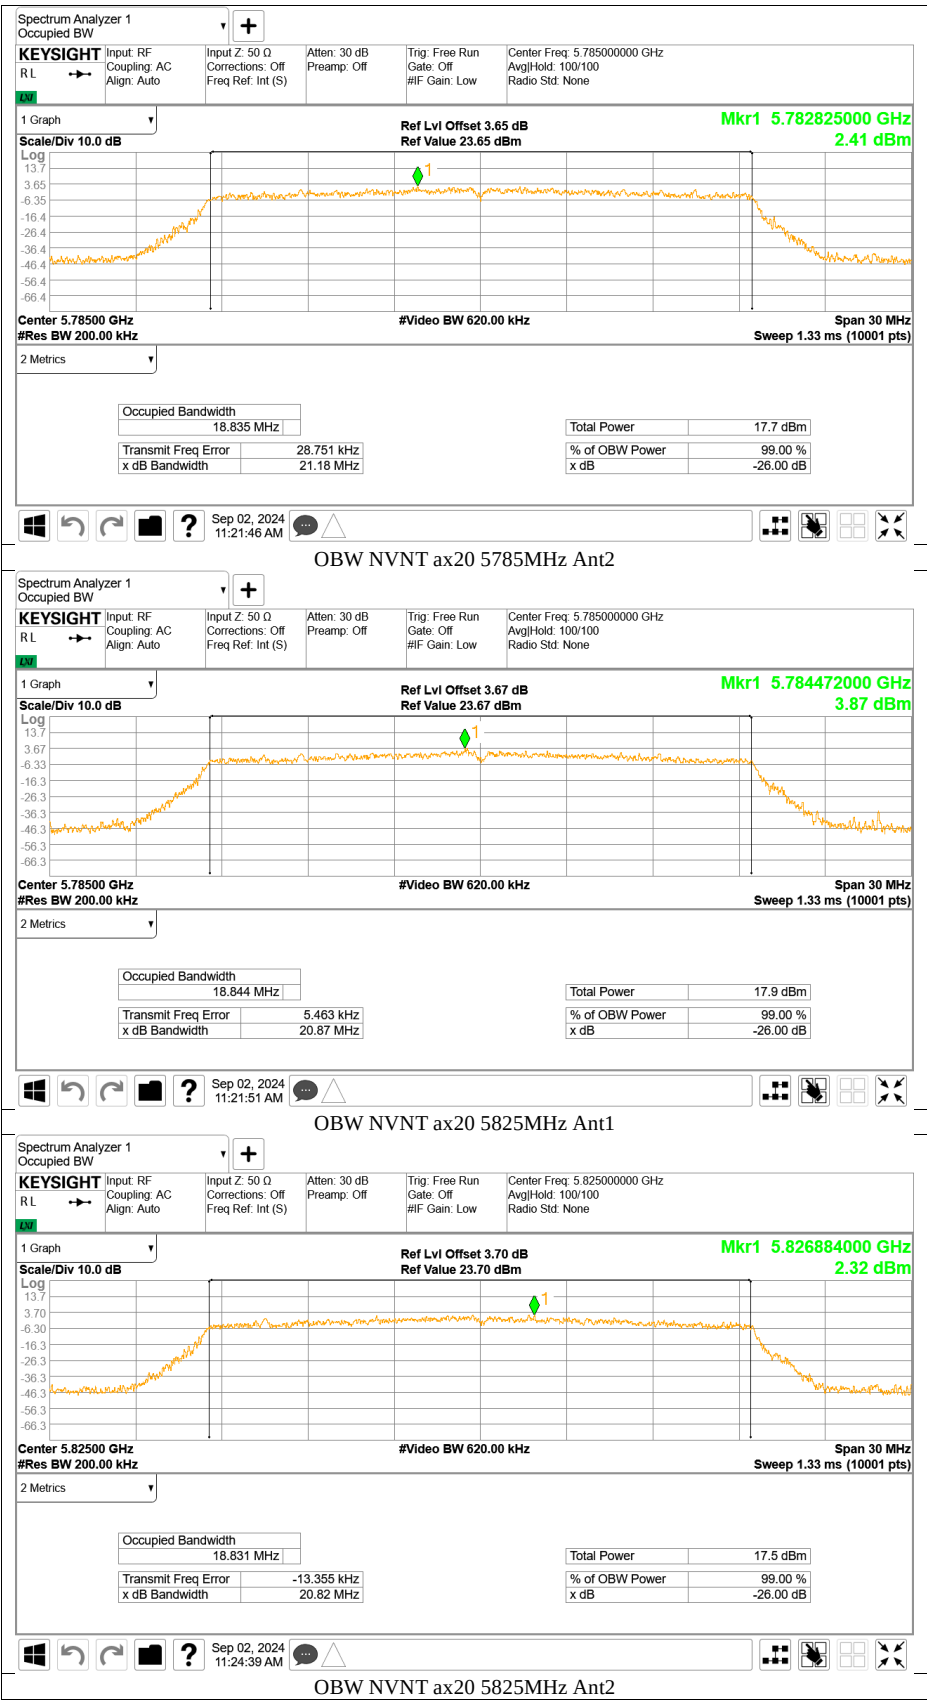


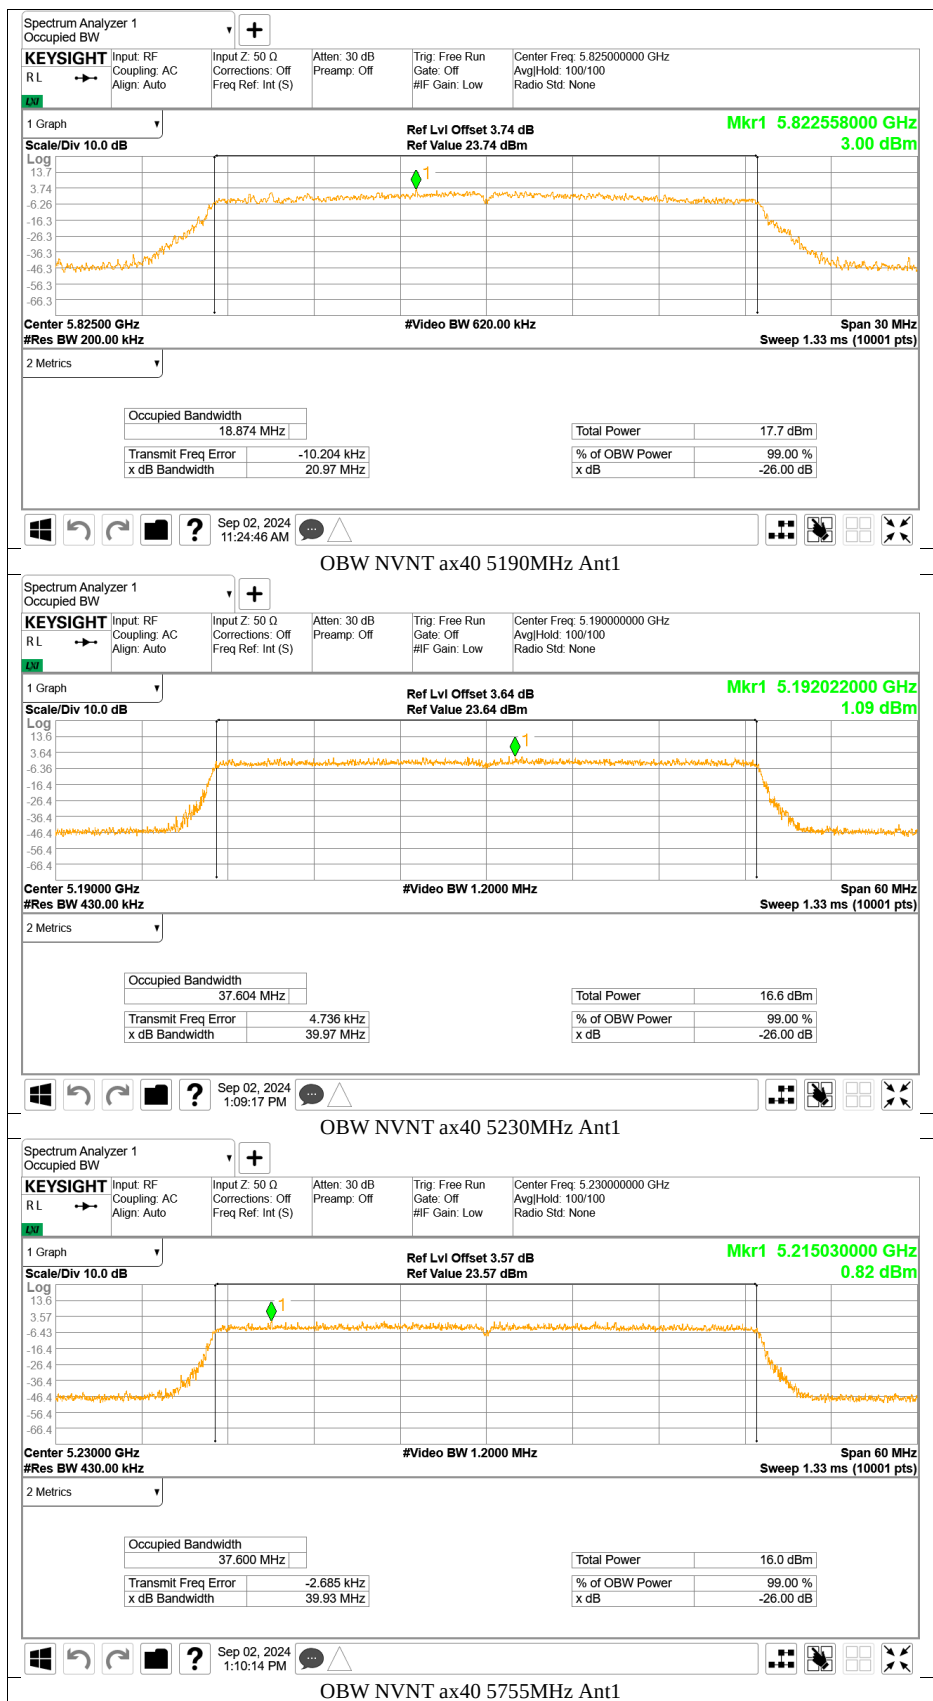


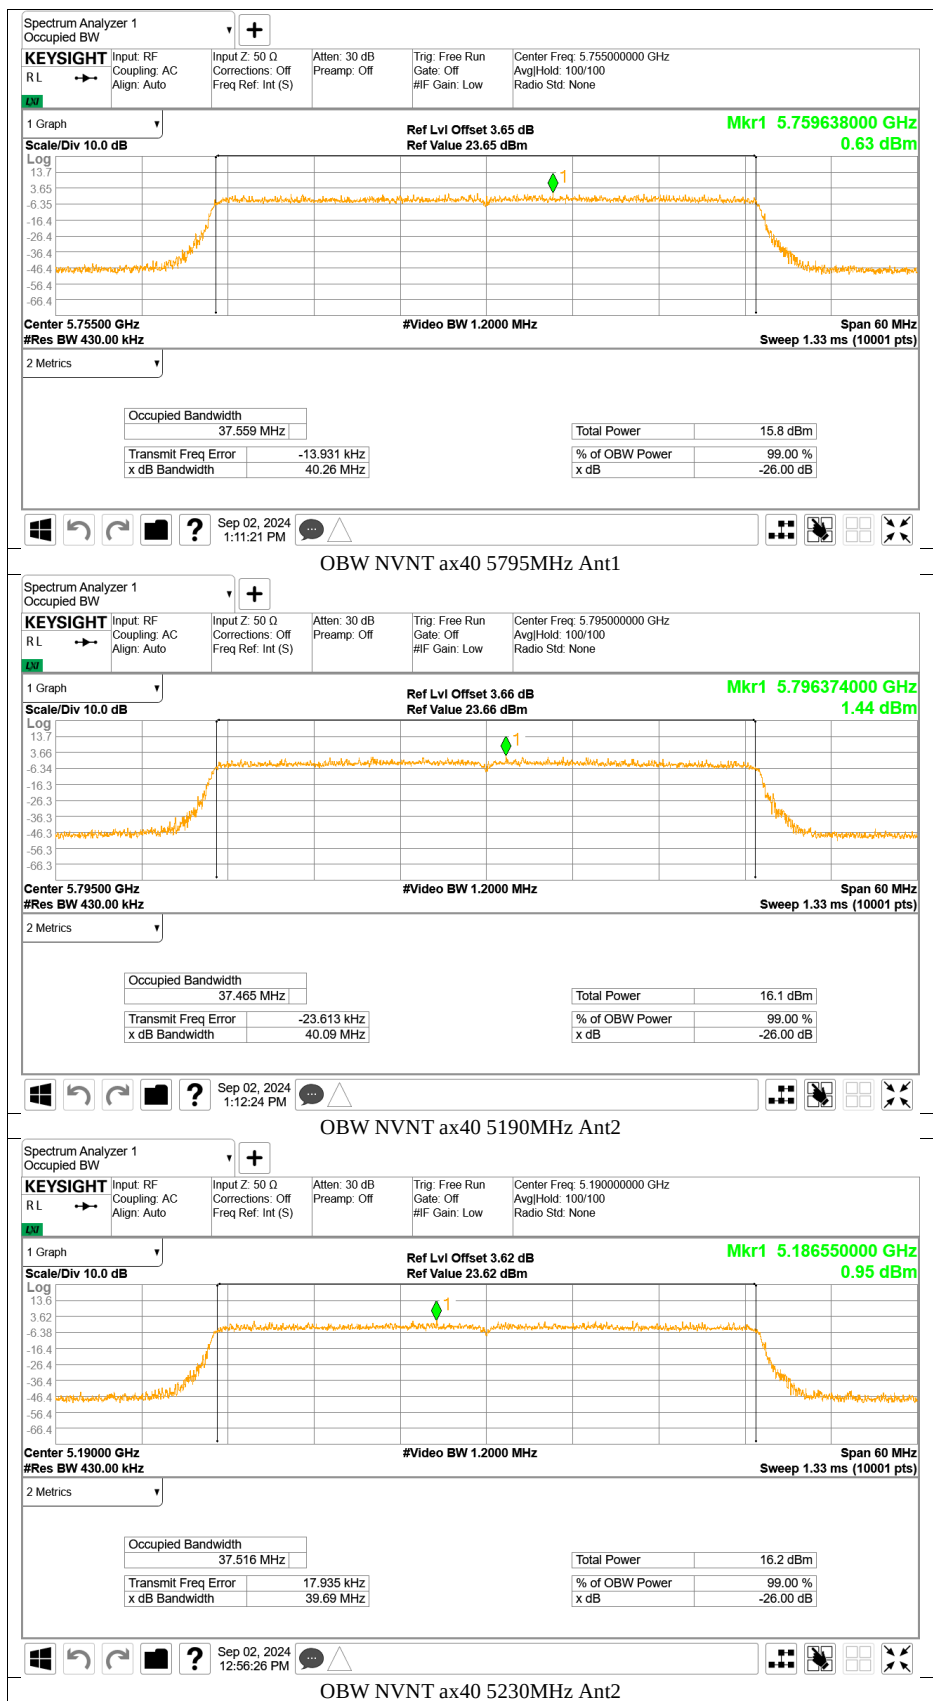


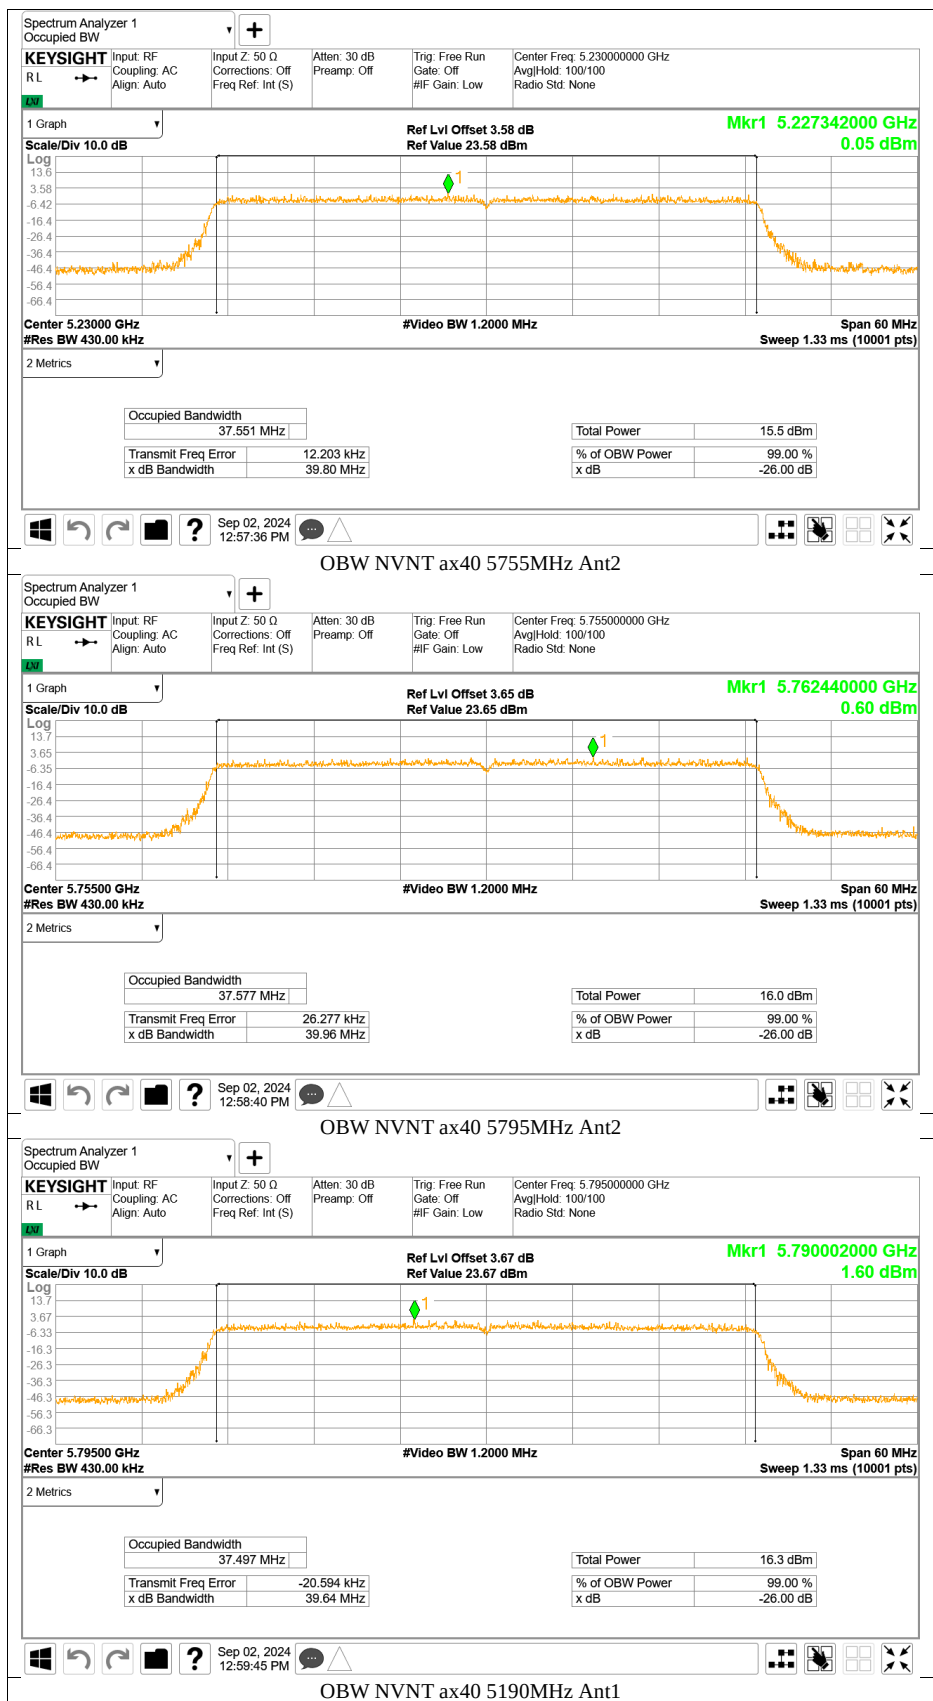


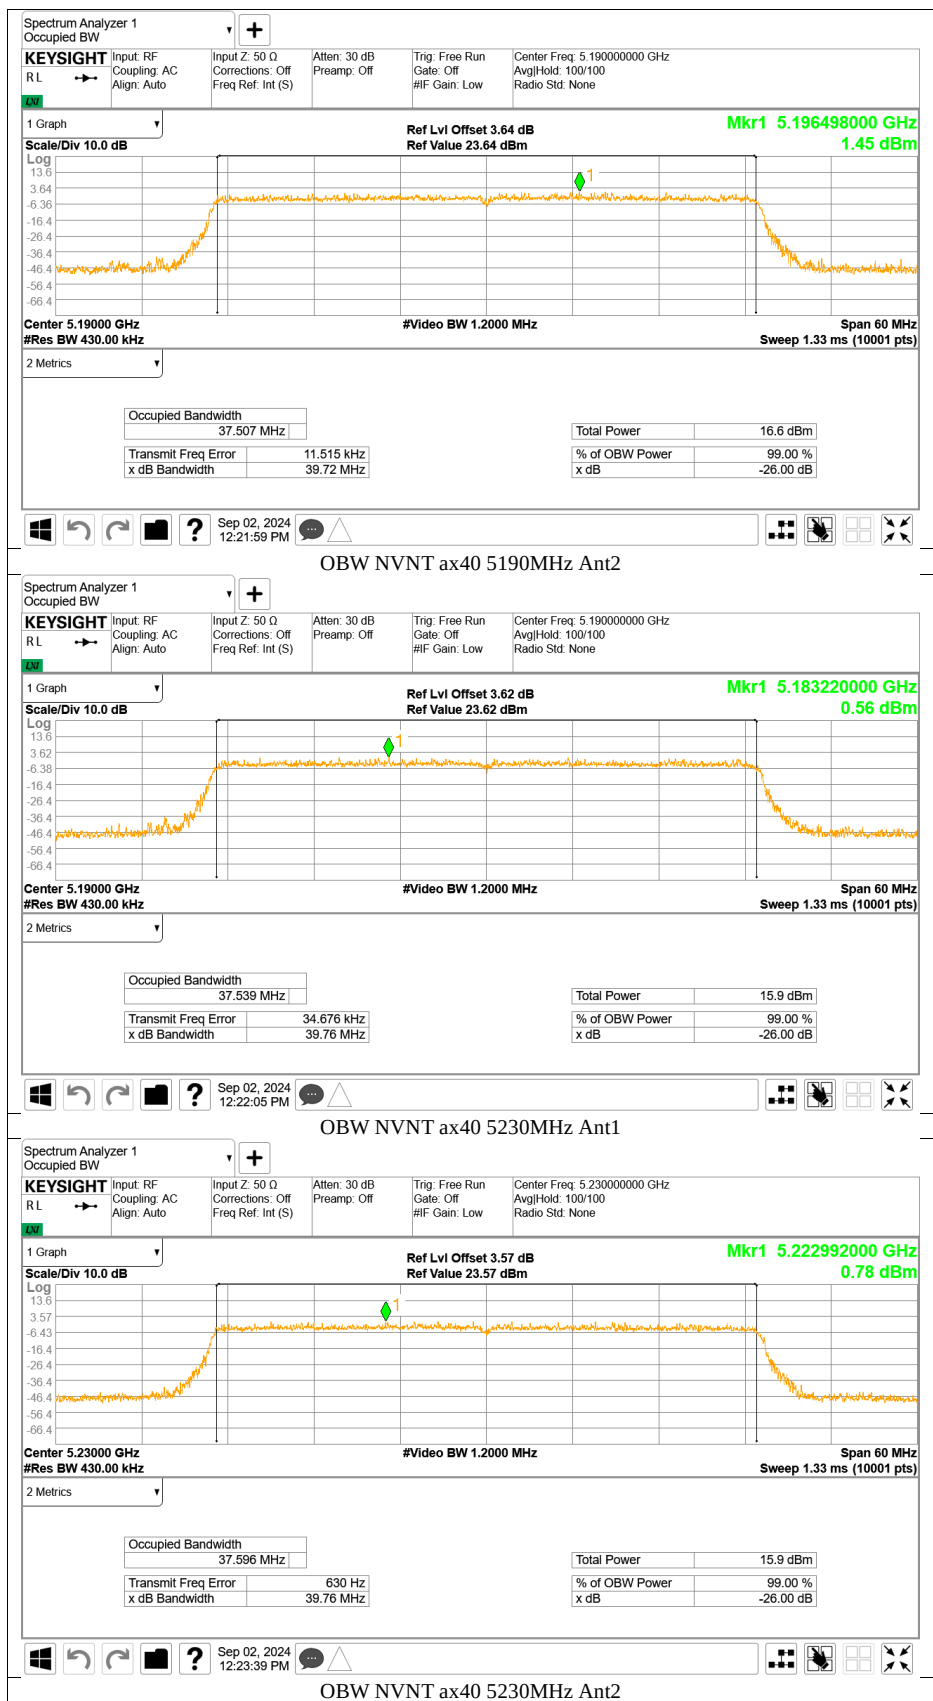

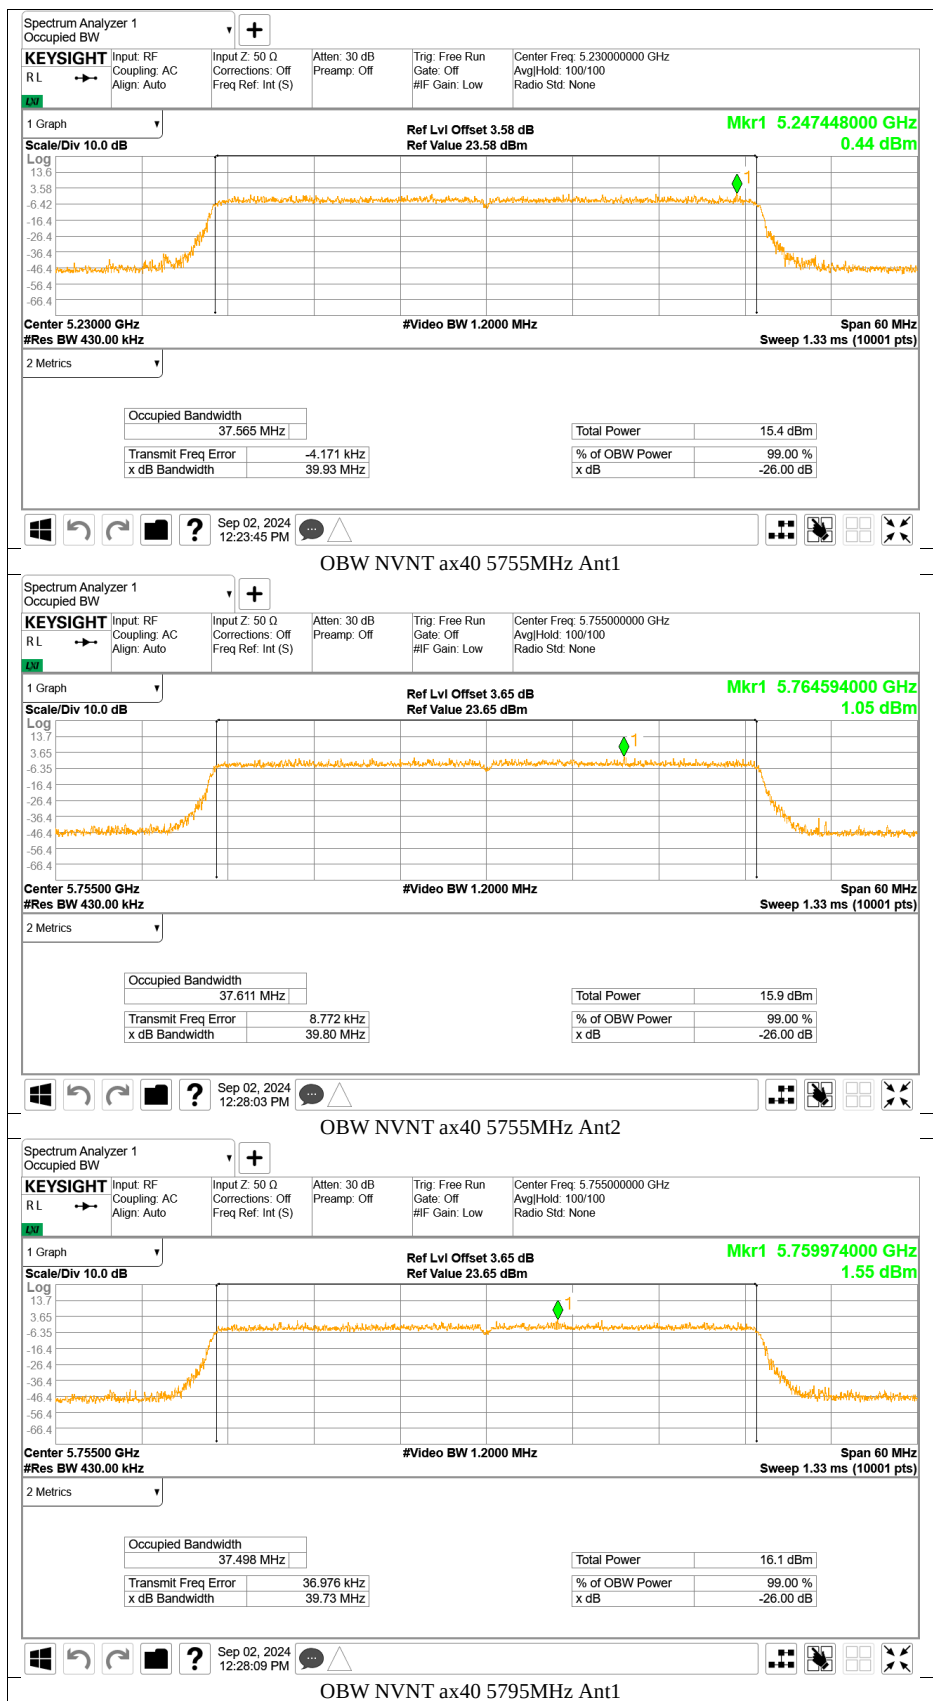

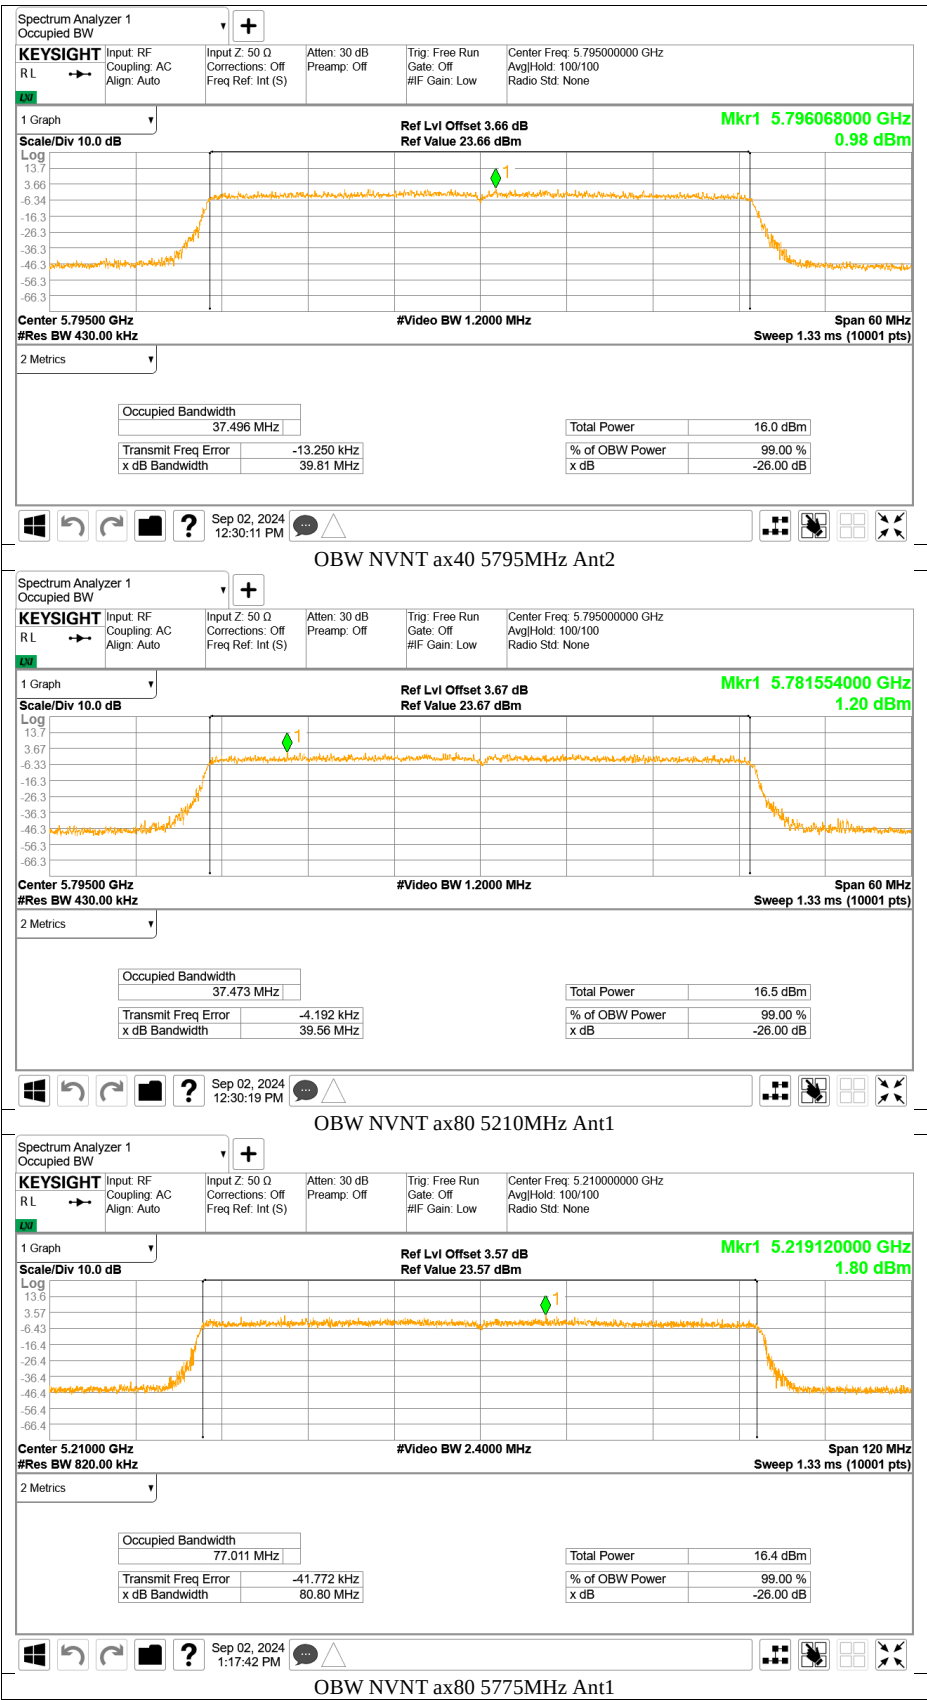

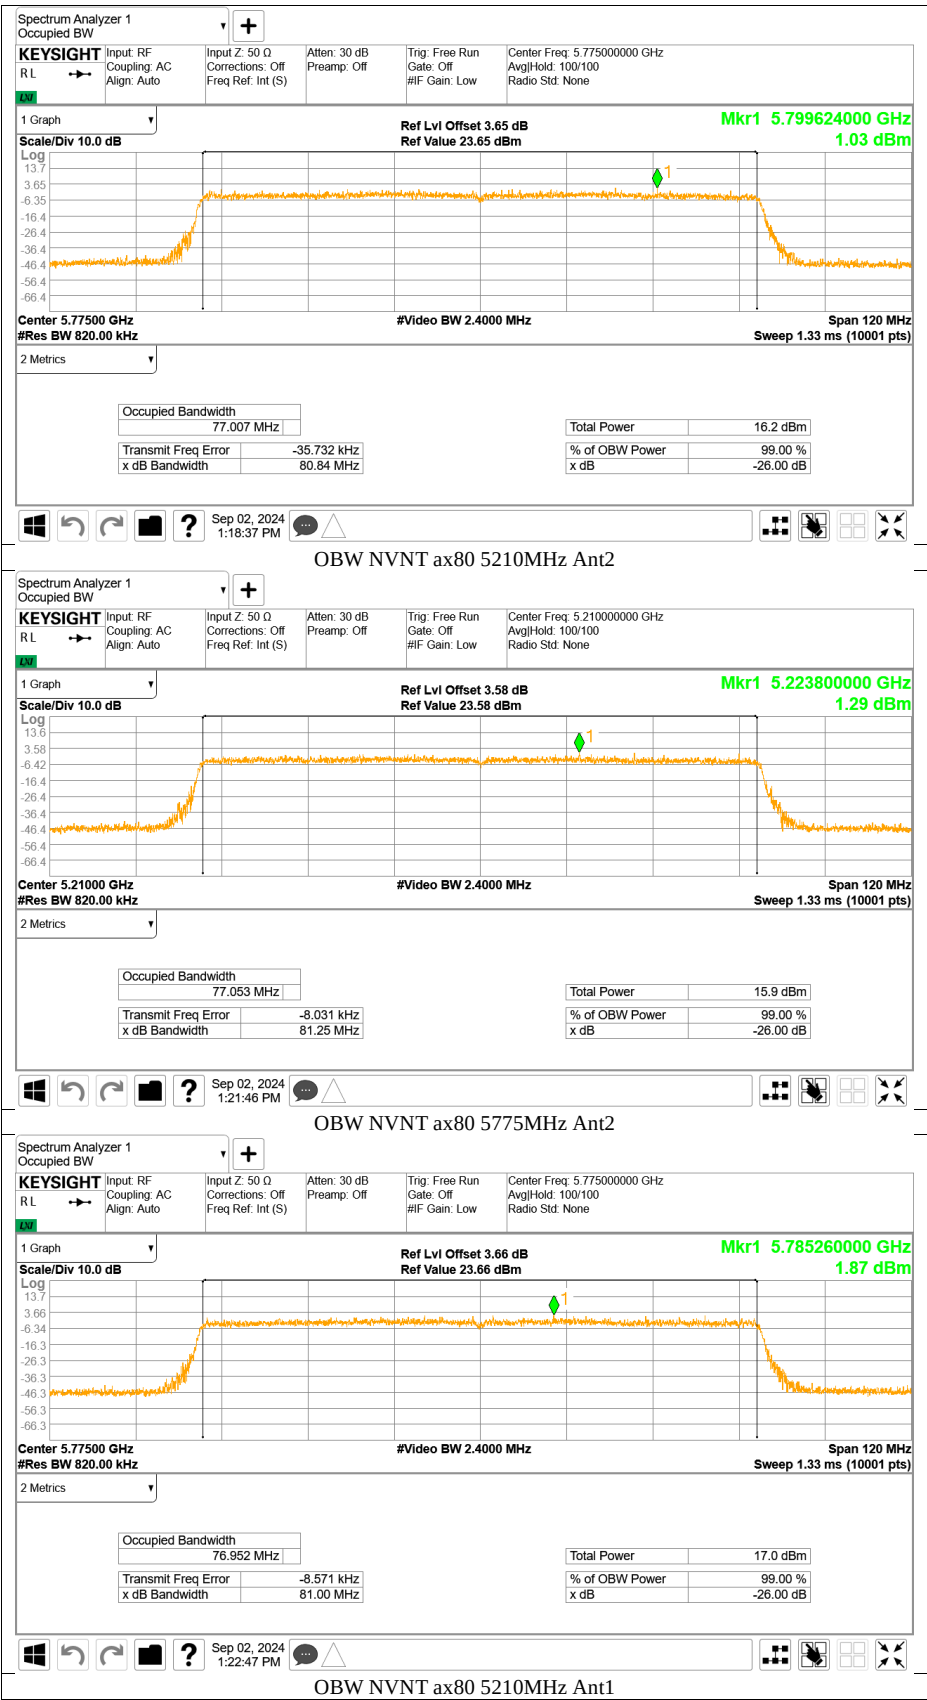

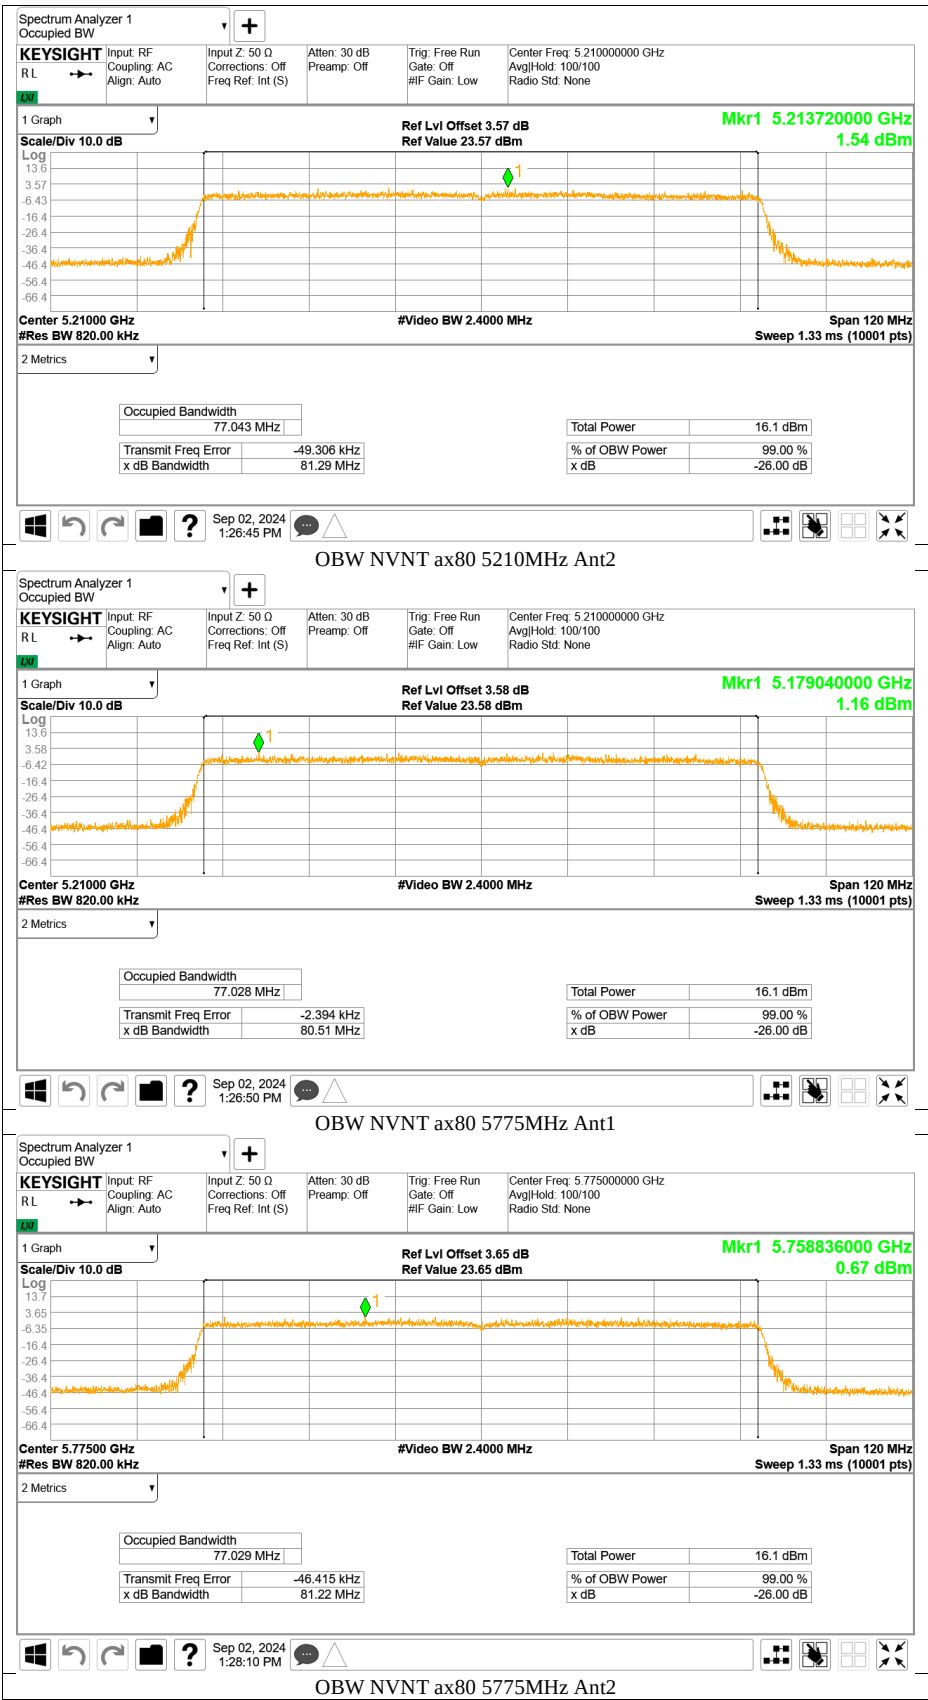





4 Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	IC Limit (dBm)	E.I.R.P PSD (dBm)	E.I.R.P PSD Limit (dBm)	Verdict
NVNT	a	5180	Ant1	1.67	0.29	1.96	11	--	6.22	10	Pass
NVNT	a	5200	Ant1	1.68	0.29	1.97	11	--	6.23	10	Pass
NVNT	a	5240	Ant1	0.64	0.29	0.93	11	--	5.19	10	Pass
NVNT	a	5745	Ant1	-2.39	0.29	-2.1	30	30	2.16	--	Pass
NVNT	a	5785	Ant1	-1.46	0.29	-1.17	30	30	3.09	--	Pass
NVNT	a	5825	Ant1	-1.35	0.29	-1.06	30	30	3.2	--	Pass
NVNT	a	5180	Ant2	1.49	0.29	1.78	11	--	4.87	10	Pass
NVNT	a	5200	Ant2	0.98	0.29	1.27	11	--	4.36	10	Pass
NVNT	a	5240	Ant2	0.82	0.29	1.11	11	--	4.2	10	Pass
NVNT	a	5745	Ant2	-2.37	0.29	-2.08	30	30	1.01	--	Pass
NVNT	a	5785	Ant2	-0.91	0.29	-0.62	30	30	2.47	--	Pass
NVNT	a	5825	Ant2	-1.23	0.29	-0.94	30	30	2.15	--	Pass
NVNT	a	5180	Ant1	-1.81	0.29	-1.52	11	--	2.74	10	Pass
NVNT	a	5180	Ant2	-1.31	0.29	-1.02	11	--	2.07	10	Pass
NVNT	a	5180	Sum	1.46	0.29	1.75	11	--	8.46	10	Pass
NVNT	a	5200	Ant1	-1.81	0.29	-1.52	11	--	2.74	10	Pass
NVNT	a	5200	Ant2	-1.76	0.29	-1.47	11	--	1.62	10	Pass
NVNT	a	5200	Sum	1.23	0.29	1.52	11	--	8.23	10	Pass
NVNT	a	5240	Ant1	-2.97	0.29	-2.68	11	--	1.58	10	Pass
NVNT	a	5240	Ant2	-2.3	0.29	-2.01	11	--	1.08	10	Pass
NVNT	a	5240	Sum	0.39	0.29	0.68	11	--	7.39	10	Pass
NVNT	a	5745	Ant1	-5.44	0.29	-5.15	30	30	-0.89	--	Pass
NVNT	a	5745	Ant2	-5.22	0.29	-4.93	30	30	-1.84	--	Pass
NVNT	a	5745	Sum	-2.32	0.29	-2.03	30	30	4.68	--	Pass
NVNT	a	5785	Ant1	-4.79	0.29	-4.5	30	30	-0.24	--	Pass
NVNT	a	5785	Ant2	-4.52	0.29	-4.23	30	30	-1.14	--	Pass
NVNT	a	5785	Sum	-1.64	0.29	-1.35	30	30	5.36	--	Pass
NVNT	a	5825	Ant1	-4.69	0.29	-4.4	30	30	-0.14	--	Pass
NVNT	a	5825	Ant2	-4.26	0.29	-3.97	30	30	-0.88	--	Pass
NVNT	a	5825	Sum	-1.46	0.29	-1.17	30	30	5.54	--	Pass
NVNT	n20	5180	Ant1	1.57	0.31	1.88	11	--	6.14	10	Pass
NVNT	n20	5200	Ant1	1.17	0.31	1.48	11	--	5.74	10	Pass
NVNT	n20	5240	Ant1	0.53	0.31	0.84	11	--	5.1	10	Pass
NVNT	n20	5745	Ant1	-2.78	0.31	-2.47	30	30	1.79	--	Pass
NVNT	n20	5785	Ant1	-1.56	0.31	-1.25	30	30	3.01	--	Pass
NVNT	n20	5825	Ant1	-1.57	0.31	-1.26	30	30	3	--	Pass
NVNT	n20	5180	Ant2	1.65	0.31	1.96	11	--	5.05	10	Pass
NVNT	n20	5200	Ant2	0.68	0.31	0.99	11	--	4.08	10	Pass
NVNT	n20	5240	Ant2	0.81	0.31	1.12	11	--	4.21	10	Pass
NVNT	n20	5745	Ant2	-2.58	0.31	-2.27	30	30	0.82	--	Pass
NVNT	n20	5785	Ant2	-1.22	0.31	-0.91	30	30	2.18	--	Pass
NVNT	n20	5825	Ant2	-1.32	0.31	-1.01	30	30	2.08	--	Pass
NVNT	n20	5180	Ant1	-1.92	0.31	-1.61	11	--	2.65	10	Pass
NVNT	n20	5180	Ant2	-1.76	0.31	-1.45	11	--	1.64	10	Pass
NVNT	n20	5180	Sum	1.17	0.31	1.48	11	--	8.19	10	Pass
NVNT	n20	5200	Ant1	-1.93	0.31	-1.62	11	--	2.64	10	Pass
NVNT	n20	5200	Ant2	-2.1	0.31	-1.79	11	--	1.3	10	Pass
NVNT	n20	5200	Sum	1	0.31	1.31	11	--	8.02	10	Pass
NVNT	n20	5240	Ant1	-3.02	0.31	-2.71	11	--	1.55	10	Pass
NVNT	n20	5240	Ant2	-2.88	0.31	-2.57	11	--	0.52	10	Pass
NVNT	n20	5240	Sum	0.06	0.31	0.37	11	--	7.08	10	Pass
NVNT	n20	5745	Ant1	-5.96	0.31	-5.65	30	30	-1.39	--	Pass
NVNT	n20	5745	Ant2	-5.12	0.31	-4.81	30	30	-1.72	--	Pass
NVNT	n20	5745	Sum	-2.51	0.31	-2.2	30	30	4.51	--	Pass
NVNT	n20	5785	Ant1	-4.9	0.31	-4.59	30	30	-0.33	--	Pass
NVNT	n20	5785	Ant2	-4.33	0.31	-4.02	30	30	-0.93	--	Pass
NVNT	n20	5785	Sum	-1.6	0.31	-1.29	30	30	5.42	--	Pass
NVNT	n20	5825	Ant1	-5.04	0.31	-4.73	30	30	-0.47	--	Pass
NVNT	n20	5825	Ant2	-4.67	0.31	-4.36	30	30	-1.27	--	Pass
NVNT	n20	5825	Sum	-1.84	0.31	-1.53	30	30	5.18	--	Pass
NVNT	n40	5190	Ant1	-3.48	0.6	-2.88	11	--	1.38	10	Pass
NVNT	n40	5230	Ant1	-3.75	0.61	-3.14	11	--	1.12	10	Pass
NVNT	n40	5755	Ant1	-7.28	0.61	-6.67	30	30	-2.41	--	Pass
NVNT	n40	5795	Ant1	-6.72	0.6	-6.12	30	30	-1.86	--	Pass



NVNT	n40	5190	Ant2	-3.93	0.6	-3.33	11	--	-0.24	10	Pass
NVNT	n40	5230	Ant2	-4.9	0.61	-4.29	11	--	-1.2	10	Pass
NVNT	n40	5755	Ant2	-6.58	0.61	-5.97	30	30	-2.88	--	Pass
NVNT	n40	5795	Ant2	-6.01	0	-6.01	30	30	-2.92	--	Pass
NVNT	n40	5190	Ant1	-3.28	0.61	-2.67	11	--	1.59	10	Pass
NVNT	n40	5190	Ant2	-3.91	0.61	-3.3	11	--	-0.21	10	Pass
NVNT	n40	5190	Sum	-0.57	0.61	0.04	11	--	6.75	10	Pass
NVNT	n40	5230	Ant1	-4.38	0.61	-3.77	11	--	0.49	10	Pass
NVNT	n40	5230	Ant2	-4.73	0.61	-4.12	11	--	-1.03	10	Pass
NVNT	n40	5230	Sum	-1.54	0.61	-0.93	11	--	5.78	10	Pass
NVNT	n40	5755	Ant1	-7.06	0.61	-6.45	30	30	-2.19	--	Pass
NVNT	n40	5755	Ant2	-6.16	0.61	-5.55	30	30	-2.46	--	Pass
NVNT	n40	5755	Sum	-3.58	0.61	-2.97	30	30	3.74	--	Pass
NVNT	n40	5795	Ant1	-6.35	0.6	-5.75	30	30	-1.49	--	Pass
NVNT	n40	5795	Ant2	-6.35	0.6	-5.75	30	30	-2.66	--	Pass
NVNT	n40	5795	Sum	-3.34	0.6	-2.74	30	30	3.97	--	Pass
NVNT	ac20	5180	Ant1	1.56	0	1.56	11	--	5.82	10	Pass
NVNT	ac20	5200	Ant1	1.84	0	1.84	11	--	6.1	10	Pass
NVNT	ac20	5240	Ant1	0.75	0	0.75	11	--	5.01	10	Pass
NVNT	ac20	5745	Ant1	-2.51	0	-2.51	30	30	1.75	--	Pass
NVNT	ac20	5785	Ant1	-1.63	0	-1.63	30	30	2.63	--	Pass
NVNT	ac20	5825	Ant1	-1.45	0	-1.45	30	30	2.81	--	Pass
NVNT	ac20	5180	Ant2	1.51	0	1.51	11	--	4.6	10	Pass
NVNT	ac20	5200	Ant2	0.99	0	0.99	11	--	4.08	10	Pass
NVNT	ac20	5240	Ant2	1.04	0	1.04	11	--	4.13	10	Pass
NVNT	ac20	5745	Ant2	-2.31	0	-2.31	30	30	0.78	--	Pass
NVNT	ac20	5785	Ant2	-0.79	0	-0.79	30	30	2.3	--	Pass
NVNT	ac20	5825	Ant2	-1.25	0	-1.25	30	30	1.84	--	Pass
NVNT	ac20	5180	Ant1	-1.72	0	-1.72	11	--	2.54	10	Pass
NVNT	ac20	5180	Ant2	-1.43	0	-1.43	11	--	1.66	10	Pass
NVNT	ac20	5180	Sum	1.44	0	1.44	11	--	8.15	10	Pass
NVNT	ac20	5200	Ant1	-1.88	0	-1.88	11	--	2.38	10	Pass
NVNT	ac20	5200	Ant2	-2.14	0	-2.14	11	--	0.95	10	Pass
NVNT	ac20	5200	Sum	1	0	1	11	--	7.71	10	Pass
NVNT	ac20	5240	Ant1	-2.65	0	-2.65	11	--	1.61	10	Pass
NVNT	ac20	5240	Ant2	-2.34	0	-2.34	11	--	0.75	10	Pass
NVNT	ac20	5240	Sum	0.52	0	0.52	11	--	7.23	10	Pass
NVNT	ac20	5745	Ant1	-6.16	0	-6.16	30	30	-1.9	--	Pass
NVNT	ac20	5745	Ant2	-5.35	0	-5.35	30	30	-2.26	--	Pass
NVNT	ac20	5745	Sum	-2.73	0	-2.73	30	30	3.98	--	Pass
NVNT	ac20	5785	Ant1	-4.94	0	-4.94	30	30	-0.68	--	Pass
NVNT	ac20	5785	Ant2	-4.39	0	-4.39	30	30	-1.3	--	Pass
NVNT	ac20	5785	Sum	-1.65	0	-1.65	30	30	5.06	--	Pass
NVNT	ac20	5825	Ant1	-5.04	0	-5.04	30	30	-0.78	--	Pass
NVNT	ac20	5825	Ant2	-4.59	0	-4.59	30	30	-1.5	--	Pass
NVNT	ac20	5825	Sum	-1.8	0	-1.8	30	30	4.91	--	Pass
NVNT	ac40	5190	Ant1	-2.69	0	-2.69	11	--	1.57	10	Pass
NVNT	ac40	5230	Ant1	-3.4	0	-3.4	11	--	0.86	10	Pass
NVNT	ac40	5755	Ant1	-5.87	0	-5.87	30	30	-1.61	--	Pass
NVNT	ac40	5795	Ant1	-5.92	0	-5.92	30	30	-1.66	--	Pass
NVNT	ac40	5190	Ant2	-3.51	0	-3.51	11	--	-0.42	10	Pass
NVNT	ac40	5230	Ant2	-4.2	0	-4.2	11	--	-1.11	10	Pass
NVNT	ac40	5755	Ant2	-5.97	0	-5.97	30	30	-2.88	--	Pass
NVNT	ac40	5795	Ant2	-5.77	0	-5.77	30	30	-2.68	--	Pass
NVNT	ac40	5190	Ant1	-2.54	0	-2.54	11	--	1.72	10	Pass
NVNT	ac40	5190	Ant2	-3.56	0	-3.56	11	--	-0.47	10	Pass
NVNT	ac40	5190	Sum	-0.01	0	-0.01	11	--	6.7	10	Pass
NVNT	ac40	5230	Ant1	-3.39	0	-3.39	11	--	0.87	10	Pass
NVNT	ac40	5230	Ant2	-3.9	0	-3.9	11	--	-0.81	10	Pass
NVNT	ac40	5230	Sum	-0.63	0	-0.63	11	--	6.08	10	Pass
NVNT	ac40	5755	Ant1	-6.68	0	-6.68	30	30	-2.42	--	Pass
NVNT	ac40	5755	Ant2	-6.5	0	-6.5	30	30	-3.41	--	Pass
NVNT	ac40	5755	Sum	-3.58	0	-3.58	30	30	3.13	--	Pass
NVNT	ac40	5795	Ant1	-6.09	0	-6.09	30	30	-1.83	--	Pass
NVNT	ac40	5795	Ant2	-5.86	0	-5.86	30	30	-2.77	--	Pass
NVNT	ac40	5795	Sum	-2.96	0	-2.96	30	30	3.75	--	Pass
NVNT	ac80	5210	Ant1	-7.01	0	-7.01	11	--	-2.75	10	Pass
NVNT	ac80	5775	Ant1	-9.93	0.65	-9.28	30	30	-5.02	--	Pass
NVNT	ac80	5210	Ant2	-7.41	0.66	-6.75	11	--	-3.66	10	Pass



NVNT	ac80	5775	Ant2	-8.97	0.65	-8.32	30	30	-5.23	--	Pass
NVNT	ac80	5210	Ant1	-7.36	0.66	-6.7	11	--	-2.44	10	Pass
NVNT	ac80	5210	Ant2	-7.45	0.66	-6.79	11	--	-3.7	10	Pass
NVNT	ac80	5210	Sum	-4.39	0.66	-3.73	11	--	2.98	10	Pass
NVNT	ac80	5775	Ant1	-10.19	0.66	-9.53	30	30	-5.27	--	Pass
NVNT	ac80	5775	Ant2	-9.48	0.66	-8.82	30	30	-5.73	--	Pass
NVNT	ac80	5775	Sum	-6.81	0.66	-6.15	30	30	0.56	--	Pass
NVNT	ax20	5180	Ant1	1.84	0.4	2.24	11	--	6.5	10	Pass
NVNT	ax20	5200	Ant1	1.57	0.39	1.96	11	--	6.22	10	Pass
NVNT	ax20	5240	Ant1	0.54	0.39	0.93	11	--	5.19	10	Pass
NVNT	ax20	5745	Ant1	-2.58	0.39	-2.19	30	30	2.07	--	Pass
NVNT	ax20	5785	Ant1	-1.41	0.4	-1.01	30	30	3.25	--	Pass
NVNT	ax20	5825	Ant1	-1.67	0.39	-1.28	30	30	2.98	--	Pass
NVNT	ax20	5180	Ant2	1.75	0.39	2.14	11	--	5.23	10	Pass
NVNT	ax20	5200	Ant2	0.89	0.39	1.28	11	--	4.37	10	Pass
NVNT	ax20	5240	Ant2	0.69	0.41	1.1	11	--	4.19	10	Pass
NVNT	ax20	5745	Ant2	-2.25	0.39	-1.86	30	30	1.23	--	Pass
NVNT	ax20	5785	Ant2	-1.11	0.4	-0.71	30	30	2.38	--	Pass
NVNT	ax20	5825	Ant2	-1.41	0.39	-1.02	30	30	2.07	--	Pass
NVNT	ax20	5180	Ant1	-1.47	0	-1.47	11	--	2.79	10	Pass
NVNT	ax20	5180	Ant2	-1.48	0	-1.48	11	--	1.61	10	Pass
NVNT	ax20	5180	Sum	1.54	0	1.54	11	--	8.25	10	Pass
NVNT	ax20	5200	Ant1	-1.77	0	-1.77	11	--	2.49	10	Pass
NVNT	ax20	5200	Ant2	-1.84	0	-1.84	11	--	1.25	10	Pass
NVNT	ax20	5200	Sum	1.21	0	1.21	11	--	7.92	10	Pass
NVNT	ax20	5240	Ant1	-2.3	0	-2.3	11	--	1.96	10	Pass
NVNT	ax20	5240	Ant2	-1.87	0	-1.87	11	--	1.22	10	Pass
NVNT	ax20	5240	Sum	0.93	0	0.93	11	--	7.64	10	Pass
NVNT	ax20	5745	Ant1	-5.71	0	-5.71	30	30	-1.45	--	Pass
NVNT	ax20	5745	Ant2	-5.14	0	-5.14	30	30	-2.05	--	Pass
NVNT	ax20	5745	Sum	-2.41	0	-2.41	30	30	4.3	--	Pass
NVNT	ax20	5785	Ant1	-4.92	0	-4.92	30	30	-0.66	--	Pass
NVNT	ax20	5785	Ant2	-4.05	0	-4.05	30	30	-0.96	--	Pass
NVNT	ax20	5785	Sum	-1.45	0	-1.45	30	30	5.26	--	Pass
NVNT	ax20	5825	Ant1	-5	0	-5	30	30	-0.74	--	Pass
NVNT	ax20	5825	Ant2	-3.89	0	-3.89	30	30	-0.8	--	Pass
NVNT	ax20	5825	Sum	-1.4	0	-1.4	30	30	5.31	--	Pass
NVNT	ax40	5190	Ant1	-4.5	0.72	-3.78	11	--	0.48	10	Pass
NVNT	ax40	5230	Ant1	-4.93	0.71	-4.22	11	--	0.04	10	Pass
NVNT	ax40	5755	Ant1	-8.08	0.72	-7.36	30	30	-3.1	--	Pass
NVNT	ax40	5795	Ant1	-7.8	0.71	-7.09	30	30	-2.83	--	Pass
NVNT	ax40	5190	Ant2	-4.8	0.71	-4.09	11	--	-1	10	Pass
NVNT	ax40	5230	Ant2	-5.57	0.72	-4.85	11	--	-1.76	10	Pass
NVNT	ax40	5755	Ant2	-7.49	0.71	-6.78	30	30	-3.69	--	Pass
NVNT	ax40	5795	Ant2	-7.26	0.71	-6.55	30	30	-3.46	--	Pass
NVNT	ax40	5190	Ant1	-4.38	0.72	-3.66	11	--	0.6	10	Pass
NVNT	ax40	5190	Ant2	-4.97	0.72	-4.25	11	--	-1.16	10	Pass
NVNT	ax40	5190	Sum	-1.65	0.72	-0.93	11	--	5.78	10	Pass
NVNT	ax40	5230	Ant1	-4.91	0.71	-4.2	11	--	0.06	10	Pass
NVNT	ax40	5230	Ant2	-5.47	0.71	-4.76	11	--	-1.67	10	Pass
NVNT	ax40	5230	Sum	-2.17	0.71	-1.46	11	--	5.25	10	Pass
NVNT	ax40	5755	Ant1	-7.95	0.71	-7.24	30	30	-2.98	--	Pass
NVNT	ax40	5755	Ant2	-7.28	0.71	-6.57	30	30	-3.48	--	Pass
NVNT	ax40	5755	Sum	-4.59	0.71	-3.88	30	30	2.83	--	Pass
NVNT	ax40	5795	Ant1	-7.65	0.71	-6.94	30	30	-2.68	--	Pass
NVNT	ax40	5795	Ant2	-7.06	0.71	-6.35	30	30	-3.26	--	Pass
NVNT	ax40	5795	Sum	-4.33	0.71	-3.62	30	30	3.09	--	Pass
NVNT	ax80	5210	Ant1	-8.34	1.24	-7.1	11	--	-2.84	10	Pass
NVNT	ax80	5775	Ant1	-11.06	1.26	-9.8	30	30	-5.54	--	Pass
NVNT	ax80	5210	Ant2	-8.5	1.24	-7.26	11	--	-4.17	10	Pass
NVNT	ax80	5775	Ant2	-10.68	1.25	-9.43	30	30	-6.34	--	Pass
NVNT	ax80	5210	Ant1	-8.77	1.26	-7.51	11	--	-3.25	10	Pass
NVNT	ax80	5210	Ant2	-8.69	1.26	-7.43	11	--	-4.34	10	Pass
NVNT	ax80	5210	Sum	-5.72	1.26	-4.46	11	--	2.25	10	Pass
NVNT	ax80	5775	Ant1	-11.57	1.26	-10.31	30	30	-6.05	--	Pass
NVNT	ax80	5775	Ant2	-10.33	1.26	-9.07	30	30	-5.98	--	Pass
NVNT	ax80	5775	Sum	-7.9	1.26	-6.64	30	30	0.07	--	Pass

