





## Restrict Band NVNT ax40 5190MHz Ant2 Peak

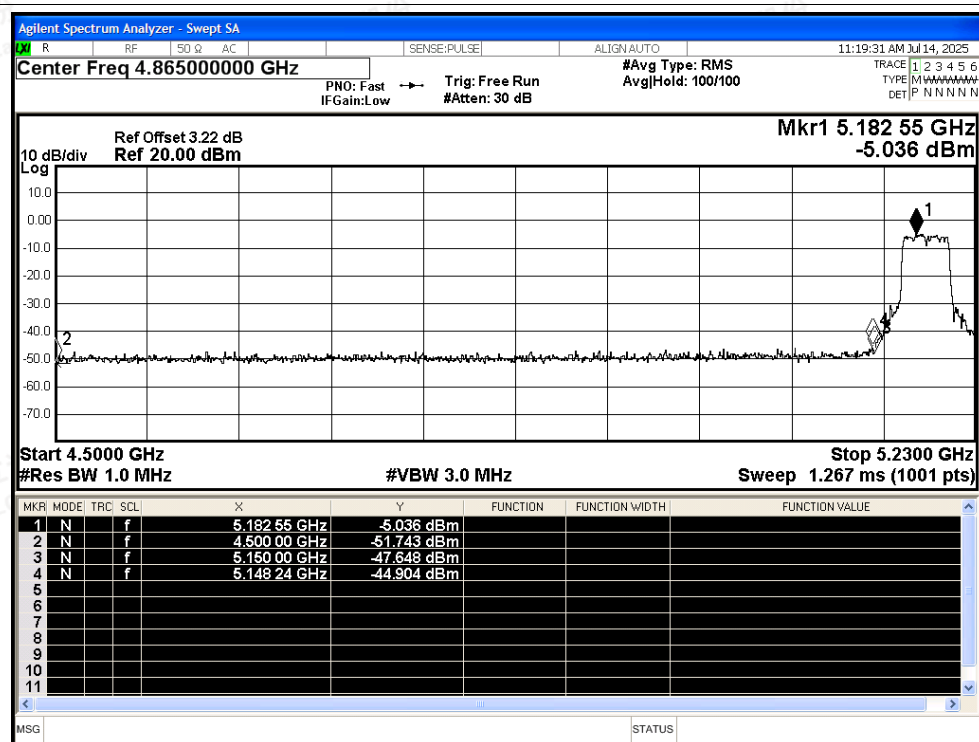

## Restrict Band NVNT ax40 5190MHz Ant2 Average

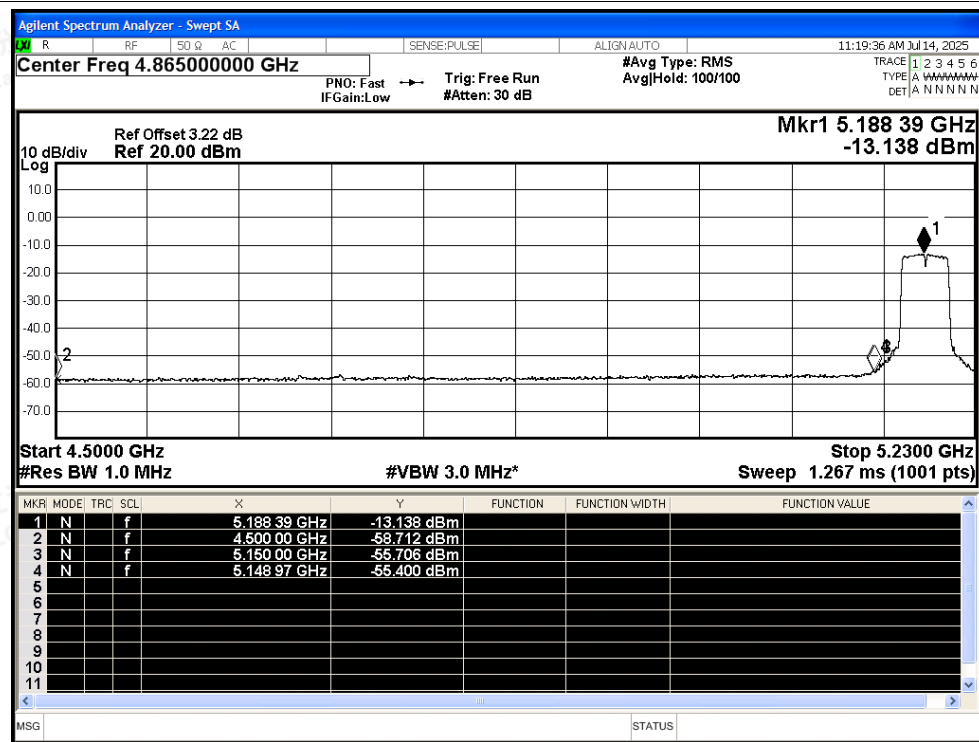

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5230MHz Ant2 Peak

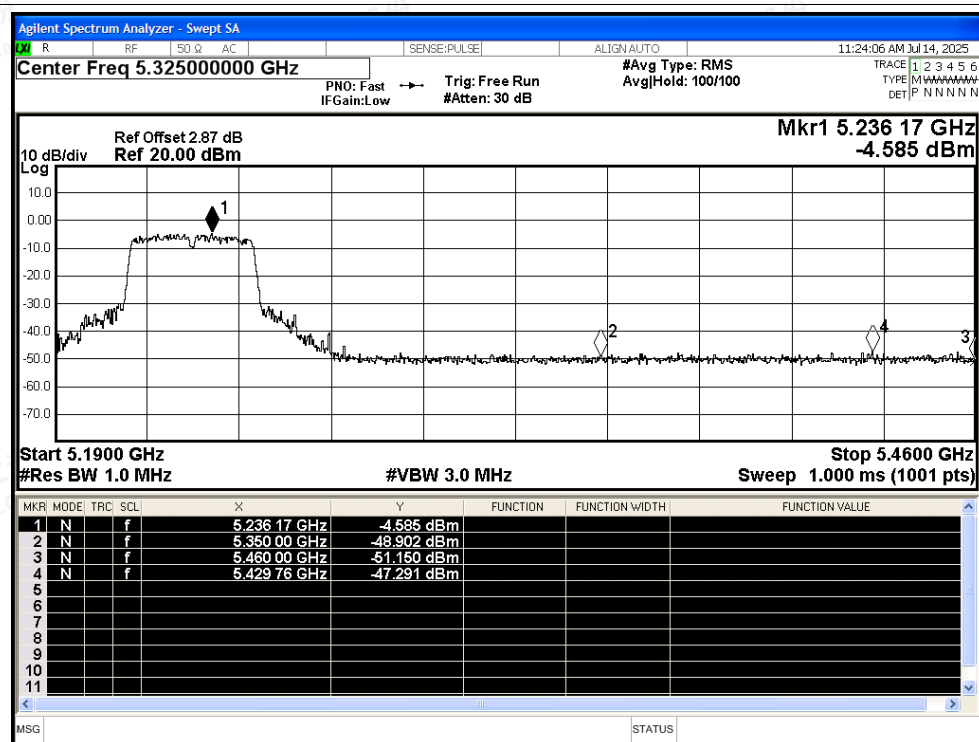

## Restrict Band NVNT ax40 5230MHz Ant2 Average

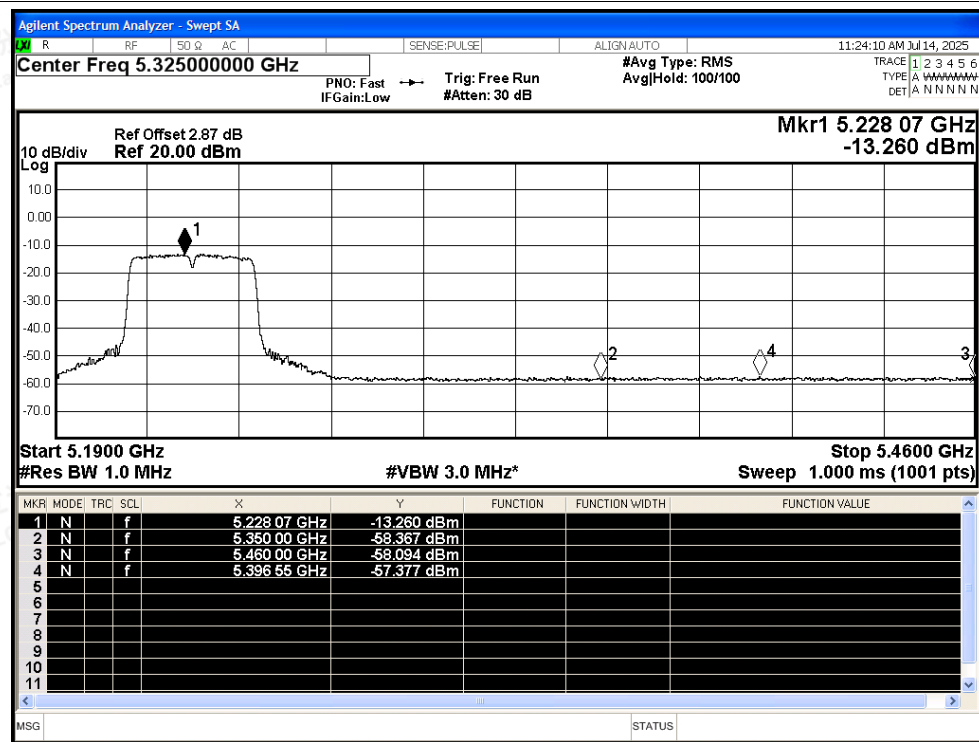

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5210MHz Ant2 Peak

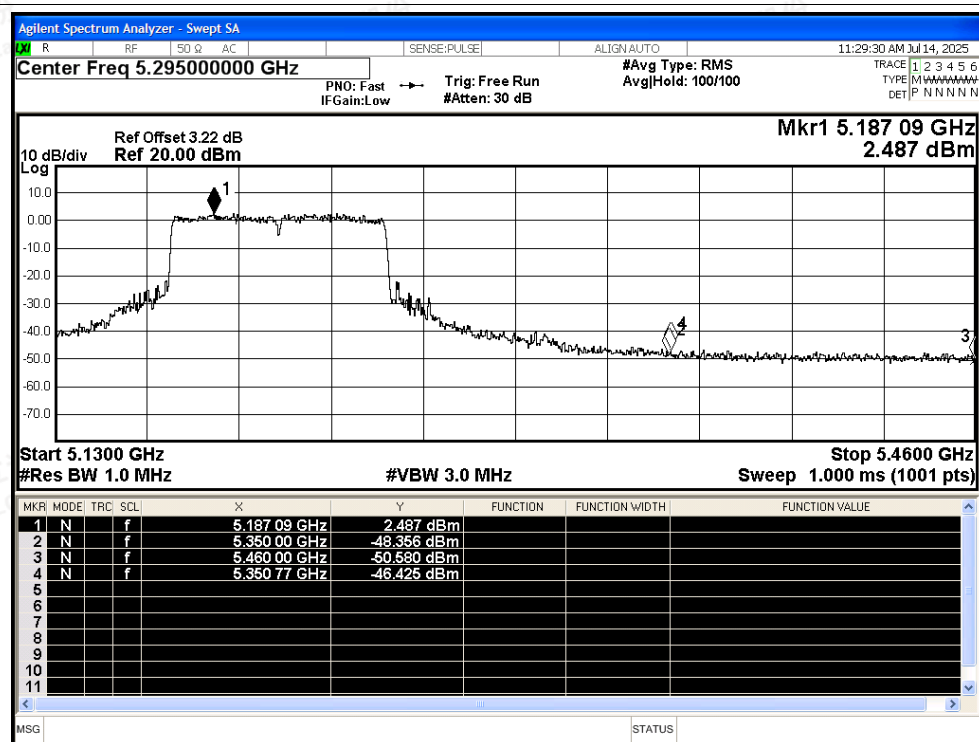

## Restrict Band NVNT ax80 5210MHz Ant2 Average

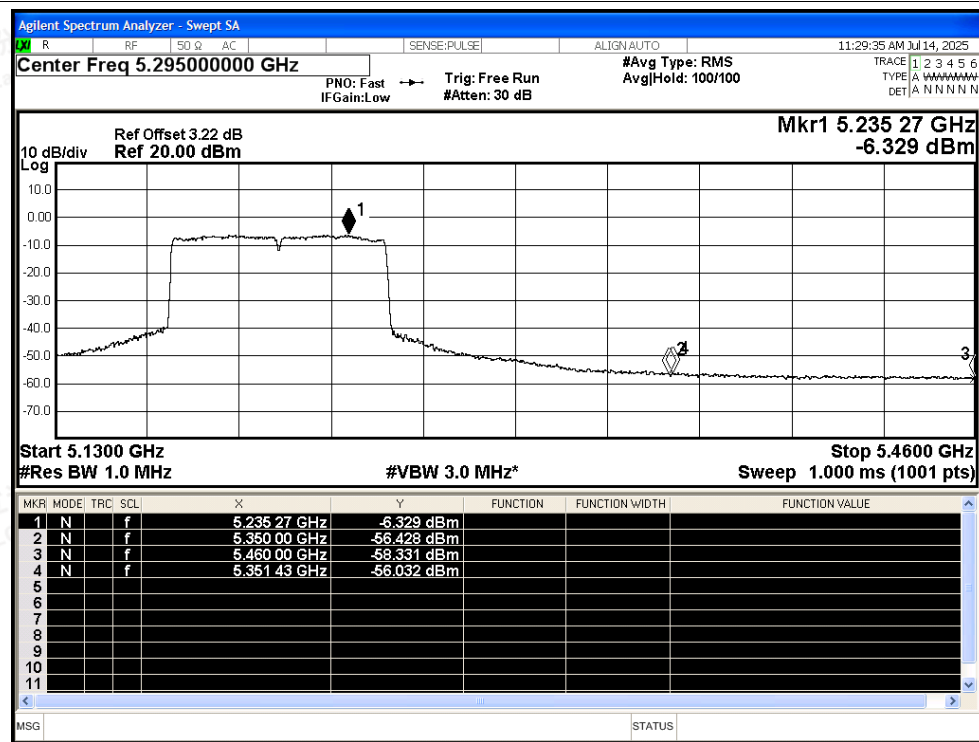

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5210MHz Ant2 Peak

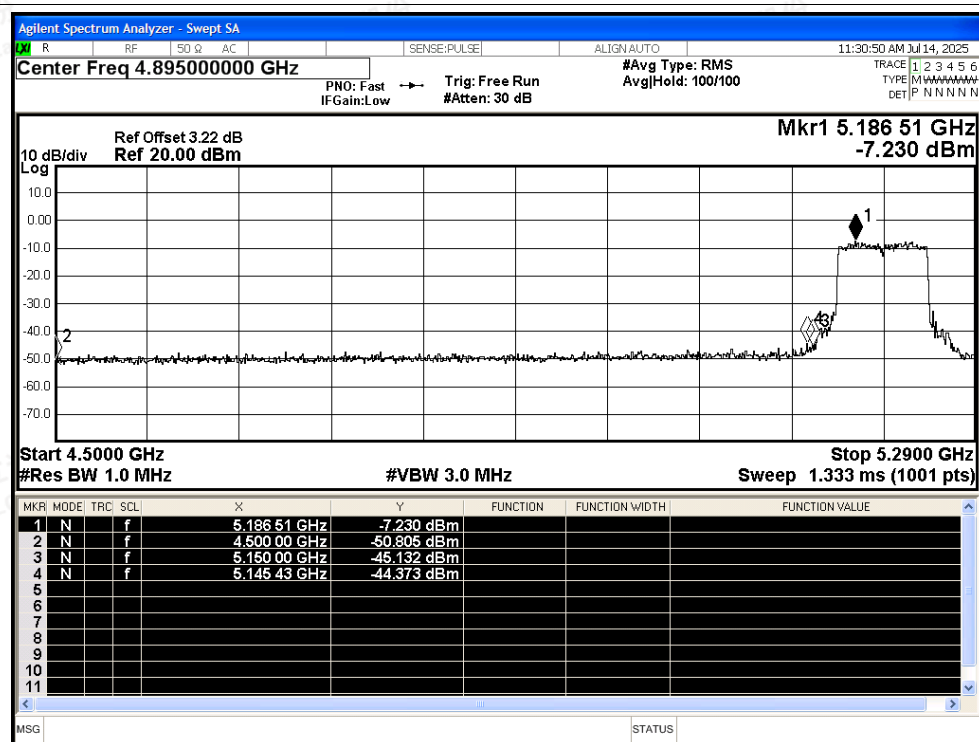

## Restrict Band NVNT ax80 5210MHz Ant2 Average

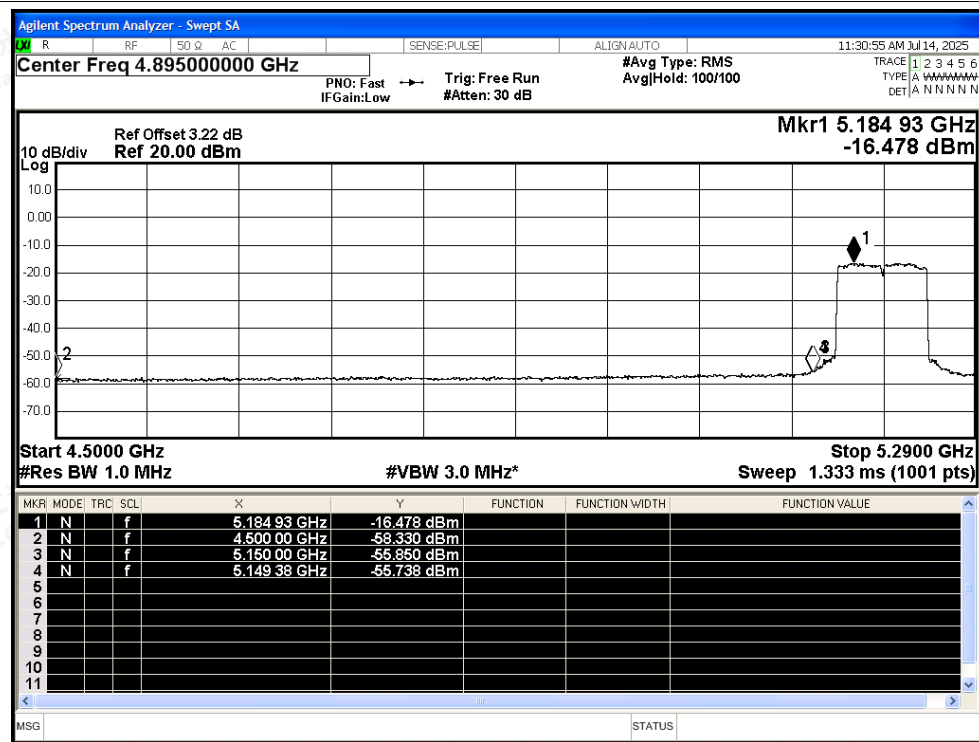

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

| Condition | Mode | Frequency<br>(MHz) | Spur Freq<br>(MHz) | Ant1<br>Power<br>(dBm) | Ant2<br>Power<br>(dBm) | Gain<br>(dBi) | E<br>(dBuV/m) | Detector | Limit<br>(dBuV/m) | Verdict |
|-----------|------|--------------------|--------------------|------------------------|------------------------|---------------|---------------|----------|-------------------|---------|
| NVNT      | n20  | 5180               | 4500               | -49.78                 | -50.93                 | 8.64          | 56.56         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5180               | 4500               | -59.09                 | -58.56                 | 8.64          | 48.06         | Average  | 54                | Pass    |
| NVNT      | n20  | 5180               | 5145.4             | -45.35                 | -45.45                 | 8.64          | 61.48         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5180               | 5148.9             | -56.27                 | -56.16                 | 8.64          | 50.66         | Average  | 54                | Pass    |
| NVNT      | n20  | 5180               | 5150               | -46.02                 | -46.04                 | 8.64          | 60.85         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5180               | 5150               | -55.77                 | -55.13                 | 8.64          | 51.44         | Average  | 54                | Pass    |
| NVNT      | n20  | 5240               | 5350               | -50.23                 | -50.29                 | 8.64          | 56.62         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5240               | 5350               | -57.94                 | -57.93                 | 8.64          | 48.94         | Average  | 54                | Pass    |
| NVNT      | n20  | 5240               | 5350.8             | -47.66                 | -47.49                 | 8.64          | 59.30         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5240               | 5402.88            | -57.52                 | -57.54                 | 8.64          | 49.35         | Average  | 54                | Pass    |
| NVNT      | n20  | 5240               | 5460               | -49.42                 | -49.81                 | 8.64          | 57.26         | Peak     | 68.2              | Pass    |
| NVNT      | n20  | 5240               | 5460               | -58.08                 | -58.43                 | 8.64          | 48.62         | Average  | 54                | Pass    |
| NVNT      | n40  | 5190               | 4500               | -49.63                 | -50.31                 | 8.64          | 56.92         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5190               | 4500               | -58.6                  | -59.21                 | 8.64          | 47.98         | Average  | 54                | Pass    |
| NVNT      | n40  | 5190               | 5148.97            | -42.16                 | -45                    | 8.64          | 63.52         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5190               | 5148.97            | -55.45                 | -55.69                 | 8.64          | 51.31         | Average  | 54                | Pass    |
| NVNT      | n40  | 5190               | 5150               | -45.83                 | -45                    | 8.64          | 61.48         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5190               | 5150               | -55.49                 | -56.14                 | 8.64          | 51.07         | Average  | 54                | Pass    |
| NVNT      | n40  | 5230               | 5350               | -49.55                 | -49.81                 | 8.64          | 57.20         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5230               | 5350               | -58.61                 | -58.32                 | 8.64          | 48.41         | Average  | 54                | Pass    |
| NVNT      | n40  | 5230               | 5428.41            | -47.14                 | -47.69                 | 8.64          | 59.47         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5230               | 5428.68            | -57.29                 | -57.45                 | 8.64          | 49.51         | Average  | 54                | Pass    |
| NVNT      | n40  | 5230               | 5460               | -49.9                  | -51.03                 | 8.64          | 56.45         | Peak     | 68.2              | Pass    |
| NVNT      | n40  | 5230               | 5460               | -58.53                 | -58.1                  | 8.64          | 48.57         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5180               | 4500               | -49.17                 | -51.29                 | 8.64          | 56.77         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5180               | 4500               | -58.61                 | -59.41                 | 8.64          | 47.88         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5180               | 5149.6             | -45.48                 | -42.05                 | 8.64          | 63.44         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5180               | 5148.9             | -55.97                 | -55.63                 | 8.64          | 51.08         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5180               | 5150               | -47.23                 | -42.66                 | 8.64          | 62.51         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5180               | 5150               | -56.17                 | -56.28                 | 8.64          | 50.65         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5240               | 4500               | -49.17                 | -51.08                 | 8.64          | 56.85         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5240               | 4500               | -58.61                 | -58.38                 | 8.64          | 48.38         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5240               | 5149.6             | -45.48                 | -47.61                 | 8.64          | 60.46         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5240               | 5148.9             | -55.97                 | -57.33                 | 8.64          | 50.28         | Average  | 54                | Pass    |
| NVNT      | ac20 | 5240               | 5150               | -47.23                 | -51.26                 | 8.64          | 58.08         | Peak     | 68.2              | Pass    |
| NVNT      | ac20 | 5240               | 5150               | -56.17                 | -58.24                 | 8.64          | 49.79         | Average  | 54                | Pass    |
| NVNT      | ac40 | 5190               | 4500               | -51.45                 | -50.1                  | 8.64          | 56.15         | Peak     | 68.2              | Pass    |
| NVNT      | ac40 | 5190               | 4500               | -58.62                 | -59.01                 | 8.64          | 48.06         | Average  | 54                | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |         |        |        |      |       |         |      |      |
|------|------|------|---------|--------|--------|------|-------|---------|------|------|
| NVNT | ac40 | 5190 | 5148.97 | -44.39 | -42.56 | 8.64 | 63.50 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5190 | 5149.7  | -55.83 | -56.1  | 8.64 | 50.91 | Average | 54   | Pass |
| NVNT | ac40 | 5190 | 5150    | -46.51 | -45.26 | 8.64 | 61.04 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5190 | 5150    | -55.83 | -56.2  | 8.64 | 50.86 | Average | 54   | Pass |
| NVNT | ac40 | 5230 | 5350    | -50.37 | -49.51 | 8.64 | 56.96 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5230 | 5350    | -58.18 | -58.65 | 8.64 | 48.47 | Average | 54   | Pass |
| NVNT | ac40 | 5230 | 5380.35 | -47.38 | -46.88 | 8.64 | 59.75 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5230 | 5373.33 | -57.4  | -57.37 | 8.64 | 49.49 | Average | 54   | Pass |
| NVNT | ac40 | 5230 | 5460    | -48.26 | -49.89 | 8.64 | 57.88 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5230 | 5460    | -58.05 | -58.41 | 8.64 | 48.65 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | 5350    | -46.85 | -47.95 | 8.64 | 59.51 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | 5350    | -56.8  | -56.38 | 8.64 | 50.29 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | 5361.99 | -46.66 | -46.53 | 8.64 | 60.28 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | 5350.44 | -56.21 | -56.03 | 8.64 | 50.76 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | 5460    | -49.19 | -50.58 | 8.64 | 57.05 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | 5460    | -57.99 | -57.75 | 8.64 | 49.01 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | 4500    | -49.89 | -49.82 | 8.64 | 57.02 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | 4500    | -58.99 | -59.16 | 8.64 | 47.80 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | 5149.38 | -42.38 | -45.51 | 8.64 | 63.21 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | 5147.01 | -55.46 | -56.15 | 8.64 | 51.08 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | 5150    | -42.53 | -37.61 | 8.64 | 67.47 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | 5150    | -55.15 | -56.66 | 8.64 | 51.04 | Average | 54   | Pass |
| NVNT | ax20 | 5180 | 4500    | -49.67 | -49.53 | 8.64 | 57.28 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5180 | 4500    | -58.74 | -58.86 | 8.64 | 48.08 | Average | 54   | Pass |
| NVNT | ax20 | 5180 | 5149.6  | -36.53 | -44.62 | 8.64 | 67.96 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5180 | 5149.6  | -52.1  | -56.37 | 8.64 | 53.15 | Average | 54   | Pass |
| NVNT | ax20 | 5180 | 5150    | -37.73 | -44.93 | 8.64 | 66.89 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5180 | 5150    | -54.71 | -56.14 | 8.64 | 51.51 | Average | 54   | Pass |
| NVNT | ax20 | 5240 | 5350    | -49.11 | -49.39 | 8.64 | 57.63 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5240 | 5350    | -57.85 | -58.6  | 8.64 | 48.67 | Average | 54   | Pass |
| NVNT | ax20 | 5240 | 5363.28 | -48.05 | -47.16 | 8.64 | 59.29 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5240 | 5368.56 | -57.37 | -57.65 | 8.64 | 49.37 | Average | 54   | Pass |
| NVNT | ax20 | 5240 | 5460    | -49.73 | -49.93 | 8.64 | 57.05 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5240 | 5460    | -58.1  | -58.31 | 8.64 | 48.67 | Average | 54   | Pass |
| NVNT | ax40 | 5190 | 4500    | -49.77 | -51.74 | 8.64 | 56.23 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5190 | 4500    | -58.95 | -58.71 | 8.64 | 48.05 | Average | 54   | Pass |
| NVNT | ax40 | 5190 | 5148.24 | -46.55 | -44.9  | 8.64 | 61.23 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5190 | 5149.7  | -55.19 | -55.4  | 8.64 | 51.58 | Average | 54   | Pass |
| NVNT | ax40 | 5190 | 5150    | -47.46 | -47.65 | 8.64 | 59.32 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5190 | 5150    | -55.19 | -55.71 | 8.64 | 51.43 | Average | 54   | Pass |
| NVNT | ax40 | 5230 | 5350    | -51.53 | -48.9  | 8.64 | 56.86 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5230 | 5350    | -58.11 | -58.37 | 8.64 | 48.64 | Average | 54   | Pass |
| NVNT | ax40 | 5230 | 5430.84 | -46.71 | -47.29 | 8.64 | 59.89 | Peak    | 68.2 | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |         |        |        |      |       |         |      |      |
|------|------|------|---------|--------|--------|------|-------|---------|------|------|
| NVNT | ax40 | 5230 | 5360.37 | -57.21 | -57.38 | 8.64 | 49.58 | Average | 54   | Pass |
| NVNT | ax40 | 5230 | 5460    | -50.91 | -51.15 | 8.64 | 55.85 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5230 | 5460    | -58.75 | -58.09 | 8.64 | 48.47 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | 5350    | -47.71 | -48.36 | 8.64 | 58.85 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | 5350    | -57.06 | -56.43 | 8.64 | 50.14 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | 5351.1  | -46.9  | -46.43 | 8.64 | 60.22 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | 5352.75 | -56.2  | -56.03 | 8.64 | 50.76 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | 5460    | -49.52 | -50.58 | 8.64 | 56.86 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | 5460    | -57.5  | -58.33 | 8.64 | 48.98 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | 4500    | -49.77 | -50.81 | 8.64 | 56.62 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | 4500    | -59.02 | -58.33 | 8.64 | 48.21 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | 5147.01 | -43.47 | -44.37 | 8.64 | 62.98 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | 5148.59 | -54.89 | -55.74 | 8.64 | 51.58 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | 5150    | -44.99 | -45.13 | 8.64 | 61.82 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | 5150    | -55.57 | -55.85 | 8.64 | 51.17 | Average | 54   | Pass |





## D.5 Frequency Stability


| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5180            | Ant1    | 5180                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a    | 5200            | Ant1    | 5200                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a    | 5240            | Ant1    | 5240                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n20  | 5180            | Ant1    | 5180                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n20  | 5200            | Ant1    | 5200                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n20  | 5240            | Ant1    | 5239.98                  | -20000               | -3.82           | 25          | Pass    |
| NVNT      | n40  | 5190            | Ant1    | 5190                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40  | 5230            | Ant1    | 5230                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5180            | Ant1    | 5180                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5200            | Ant1    | 5199.96                  | -40000               | -7.69           | 25          | Pass    |
| NVNT      | ac20 | 5240            | Ant1    | 5239.98                  | -20000               | -3.82           | 25          | Pass    |
| NVNT      | ac40 | 5190            | Ant1    | 5190                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5230            | Ant1    | 5229.96                  | -40000               | -7.65           | 25          | Pass    |
| NVNT      | ac80 | 5210            | Ant1    | 5210                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5180            | Ant1    | 5180                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5200            | Ant1    | 5200                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5240            | Ant1    | 5239.98                  | -20000               | -3.82           | 25          | Pass    |
| NVNT      | ax40 | 5190            | Ant1    | 5190                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40 | 5230            | Ant1    | 5230                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax80 | 5210            | Ant1    | 5210                     | 0                    | 0               | 25          | Pass    |






## Test Graphs

## Freq. Stability NVNT a 5180MHz Ant1

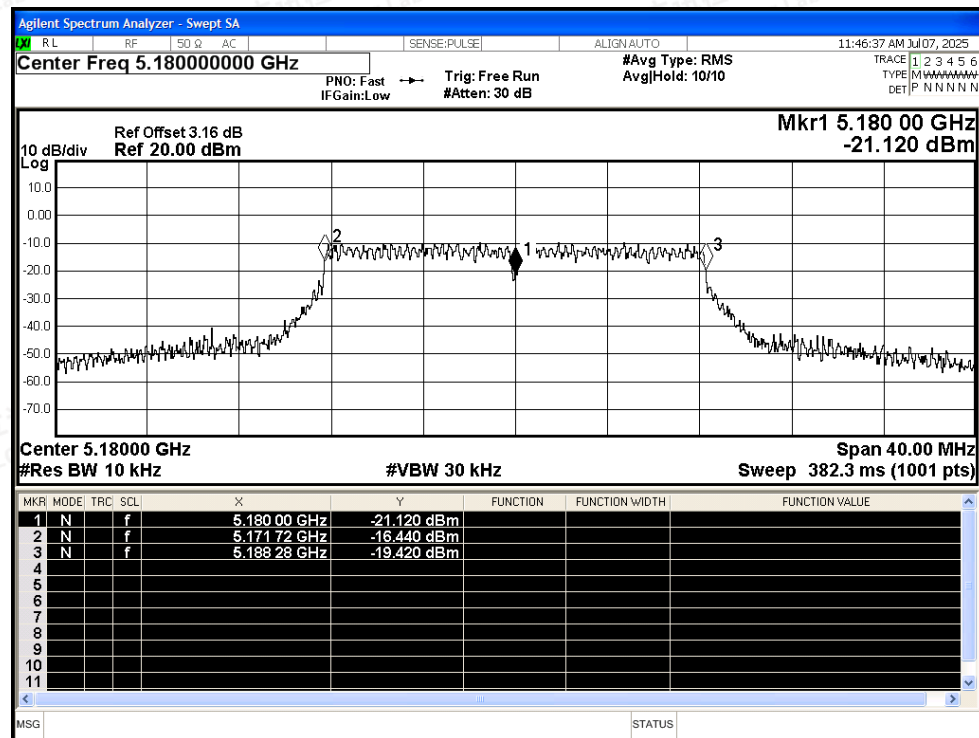

## Freq. Stability NVNT a 5200MHz Ant1

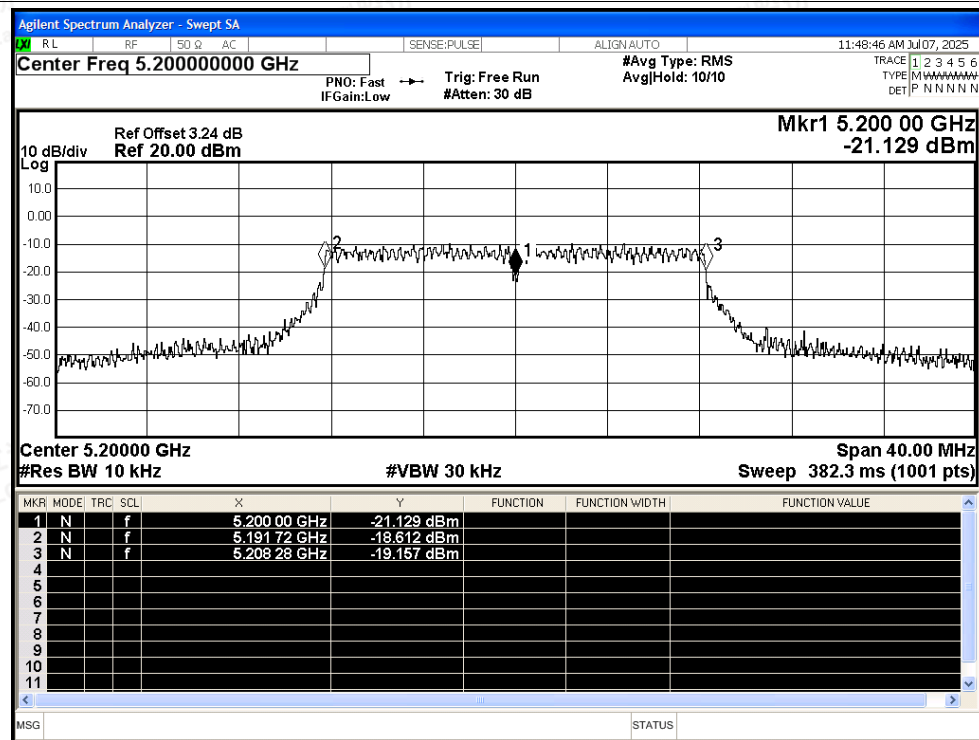

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT a 5240MHz Ant1

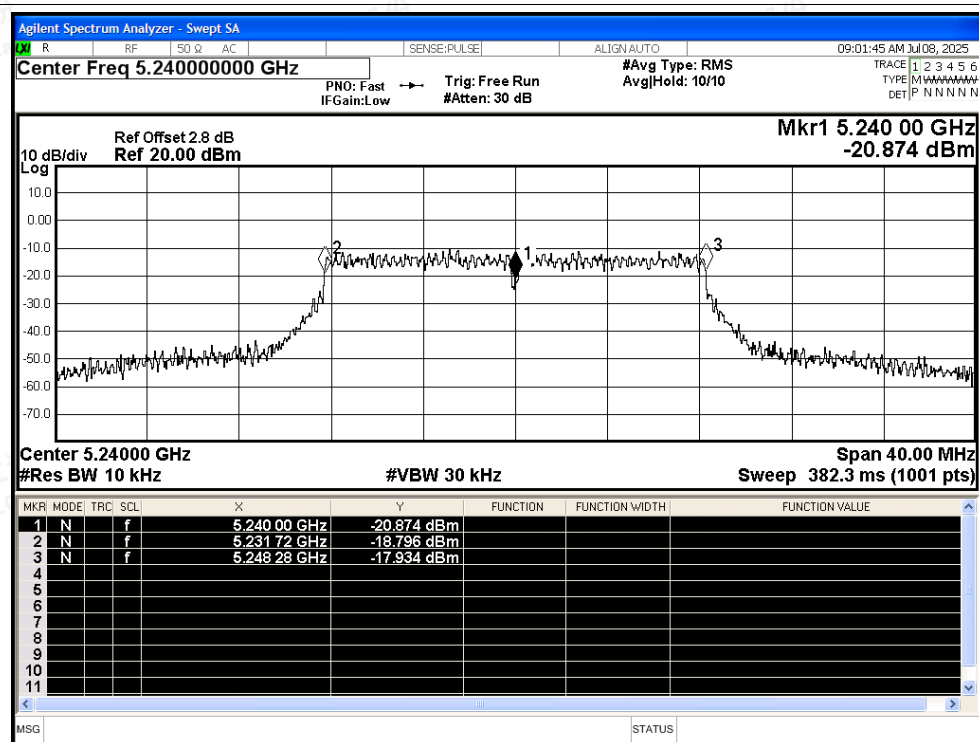

## Freq. Stability NVNT n20 5180MHz Ant1

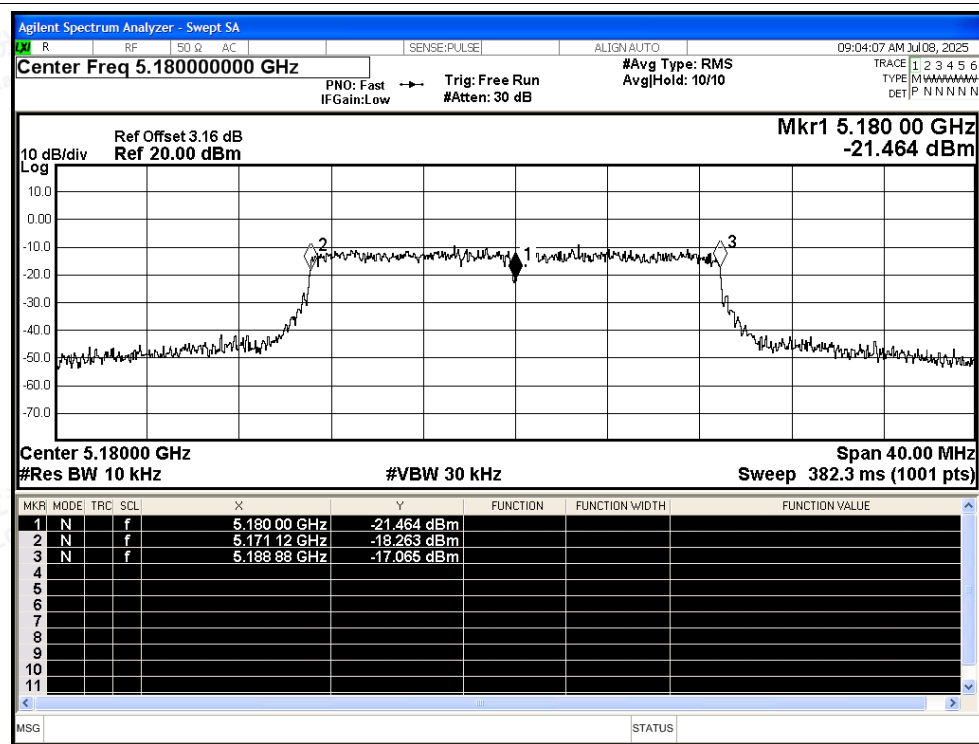

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n20 5200MHz Ant1

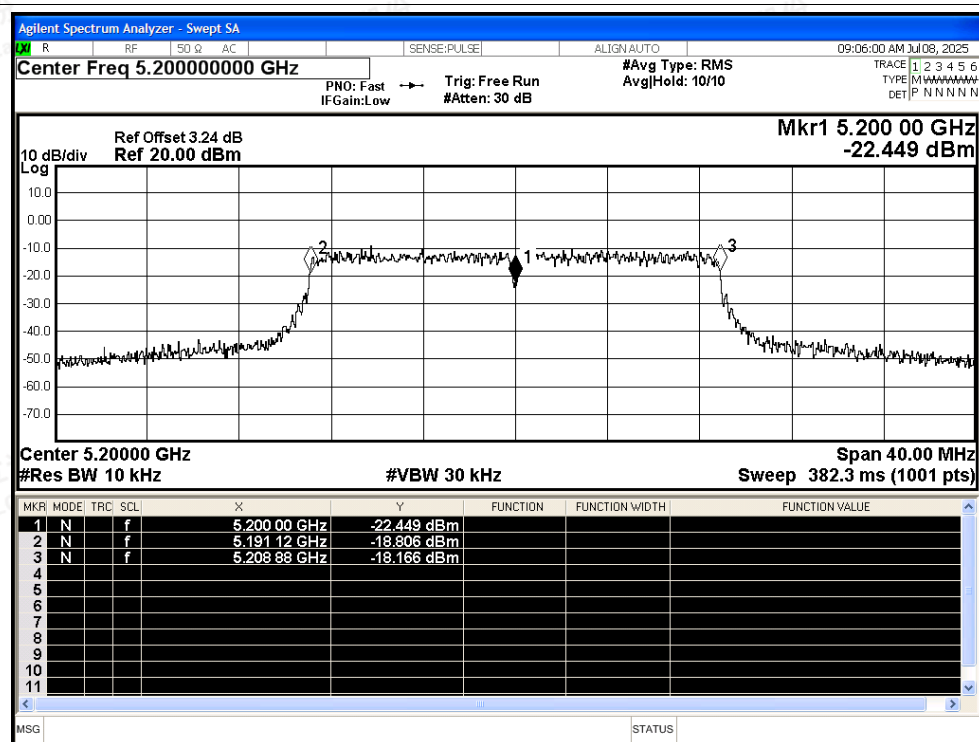

## Freq. Stability NVNT n20 5240MHz Ant1

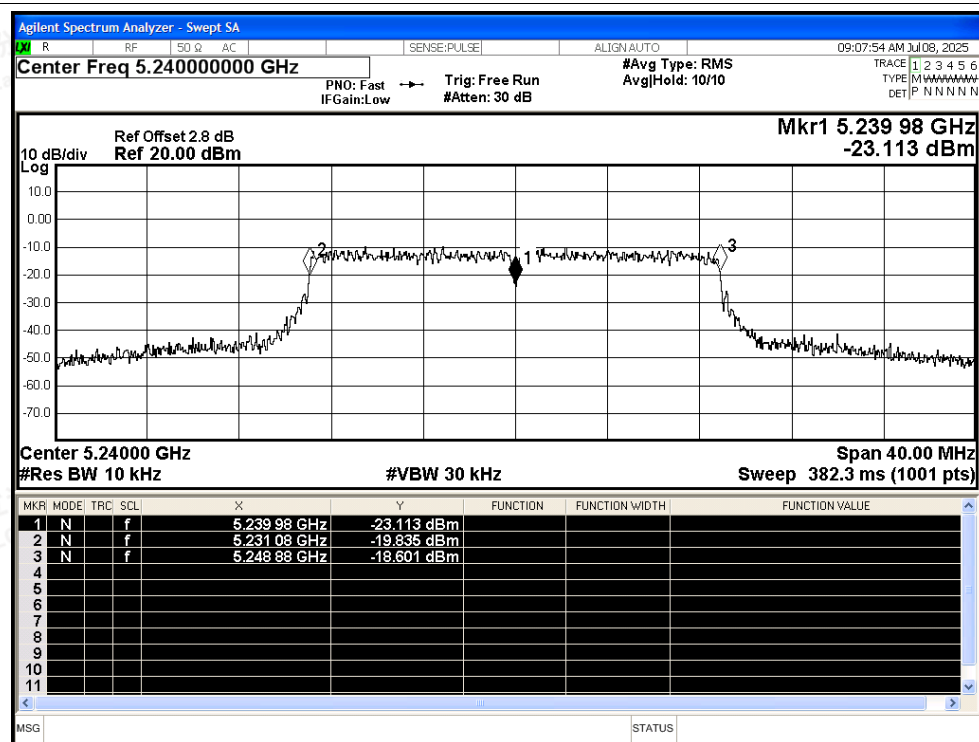

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5190MHz Ant1

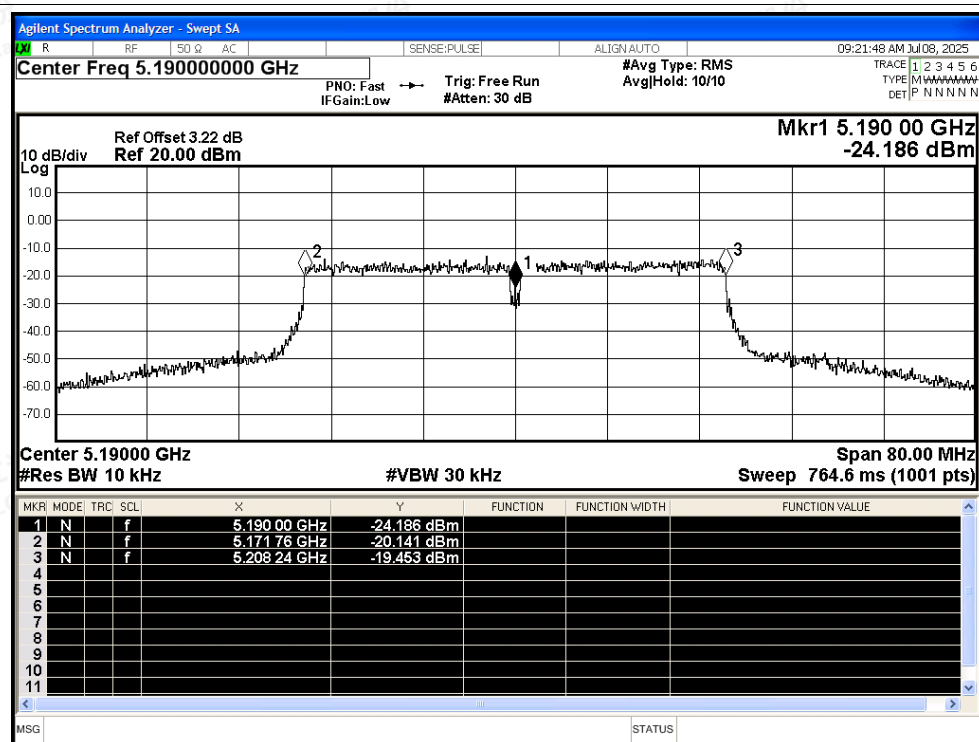

## Freq. Stability NVNT n40 5230MHz Ant1

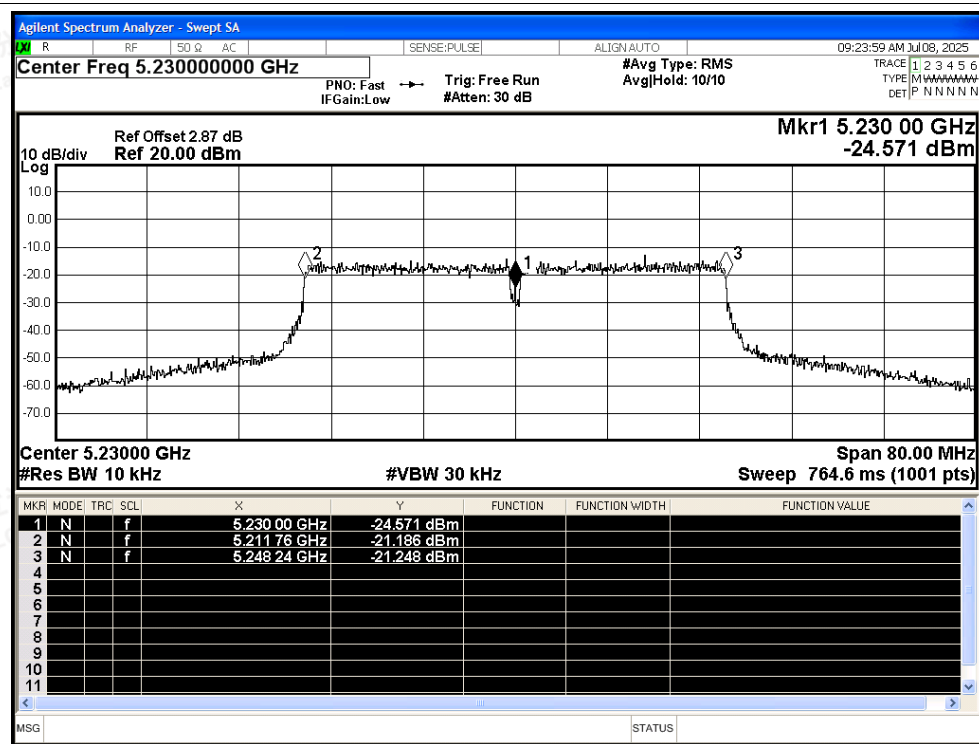

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5180MHz Ant1

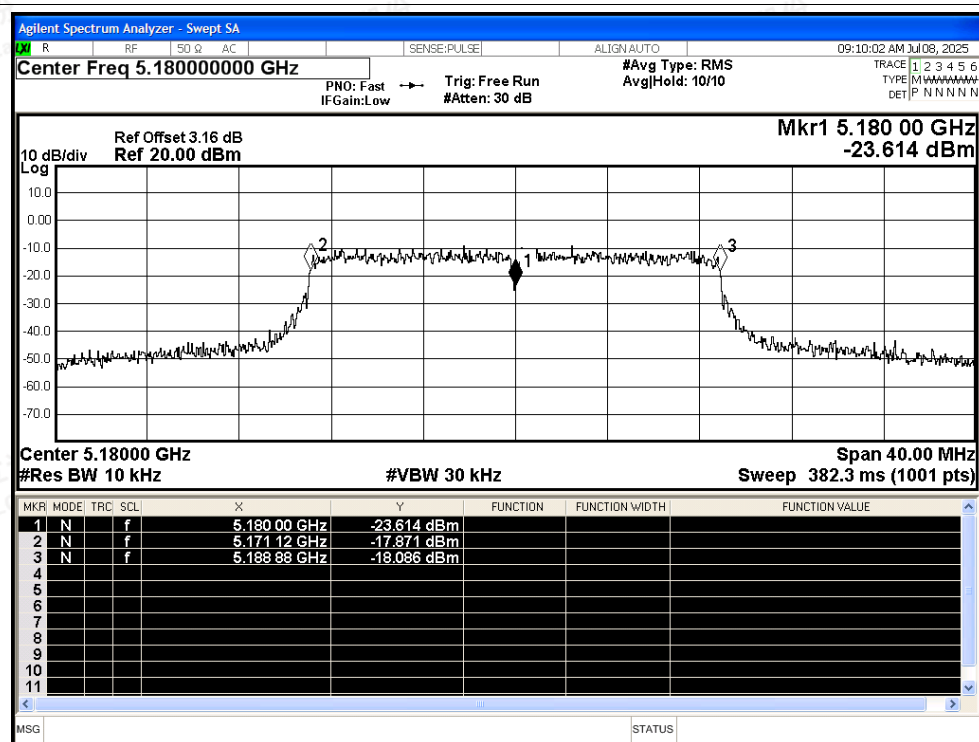

## Freq. Stability NVNT ac20 5200MHz Ant1

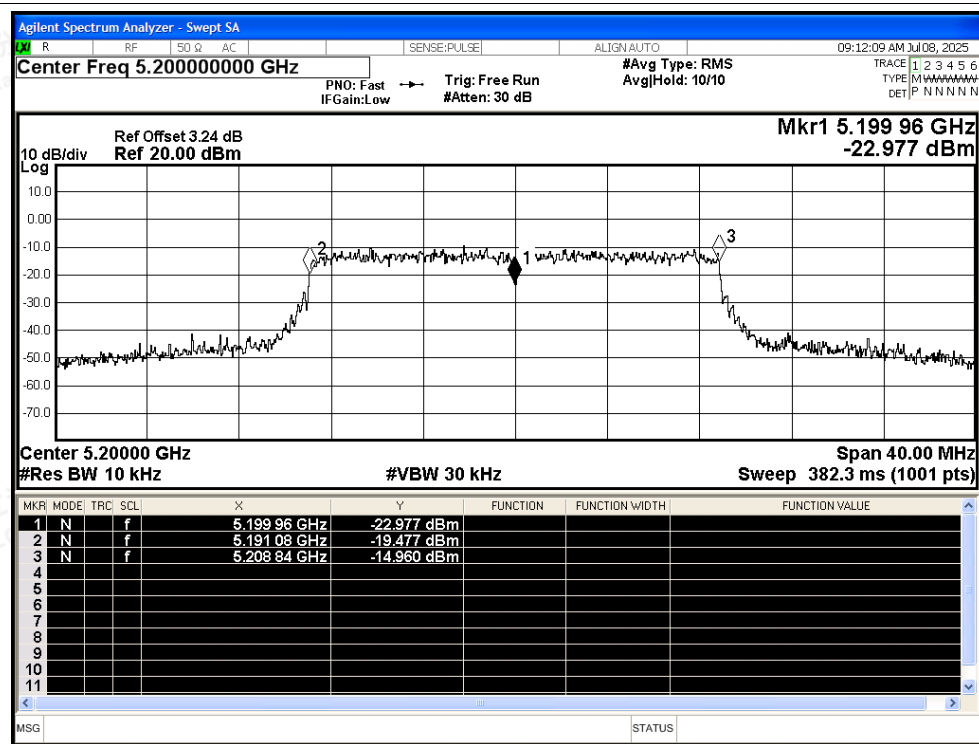

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5240MHz Ant1

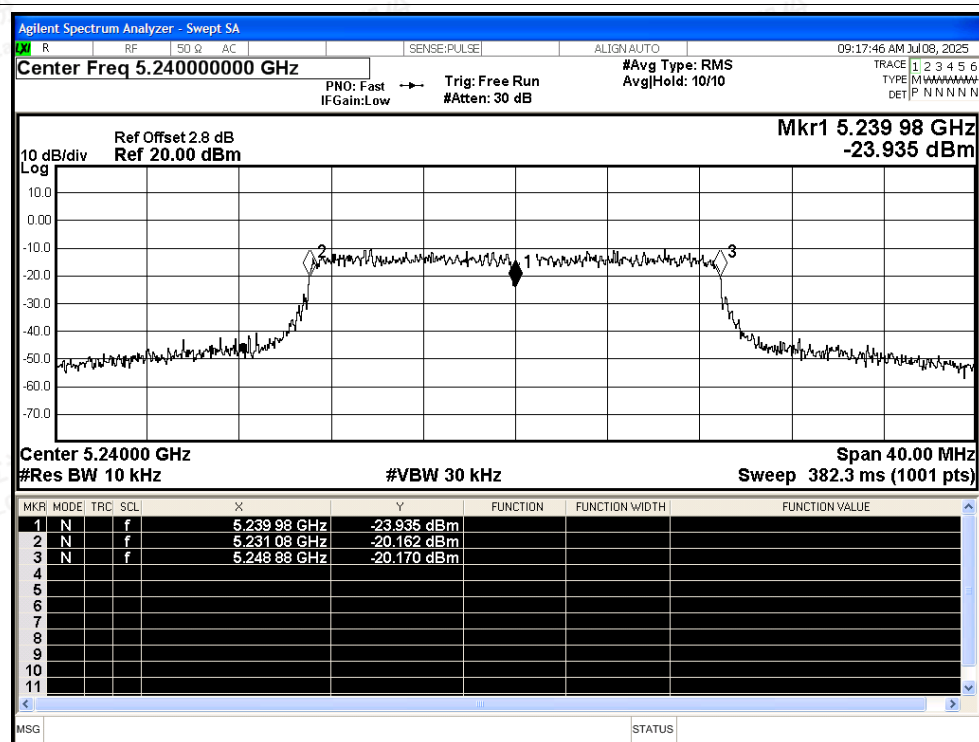

## Freq. Stability NVNT ac40 5190MHz Ant1

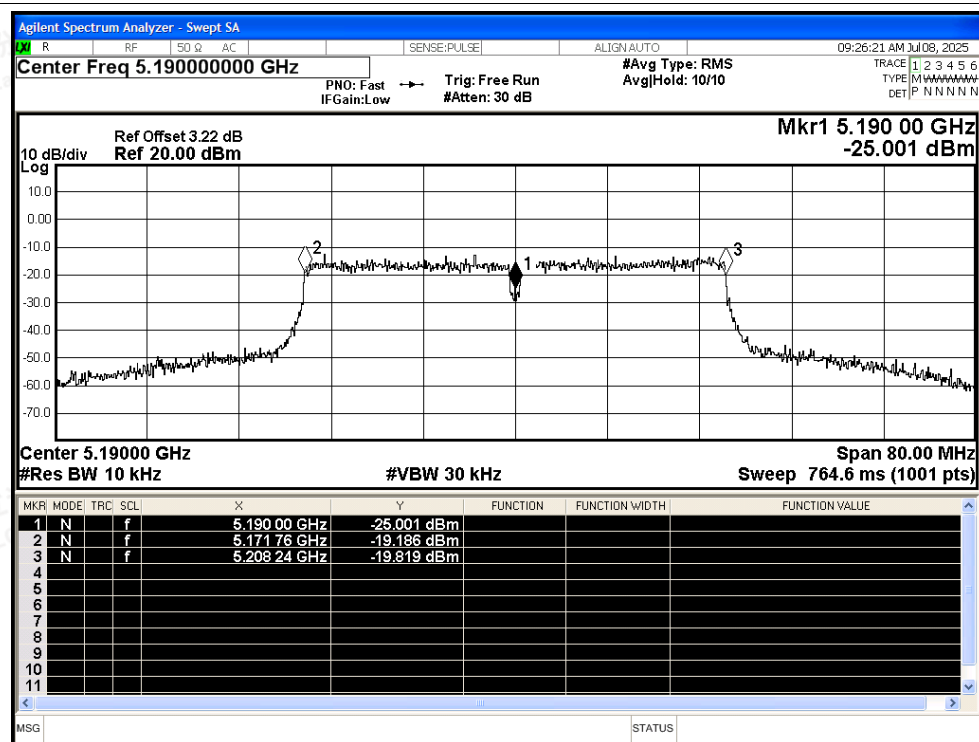

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac40 5230MHz Ant1

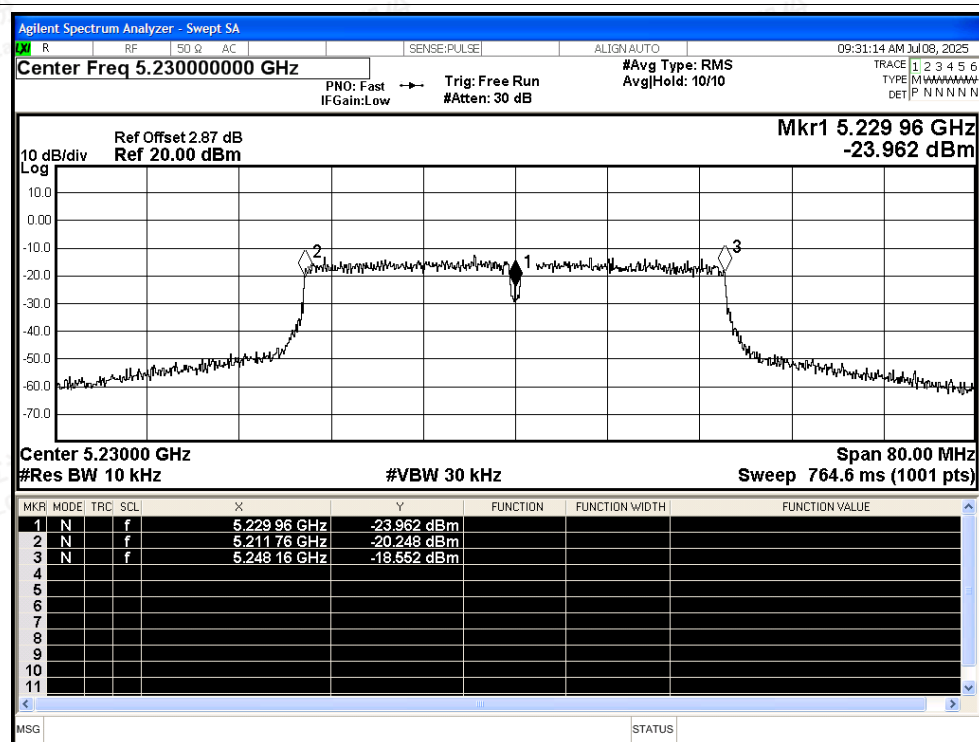

## Freq. Stability NVNT ac80 5210MHz Ant1

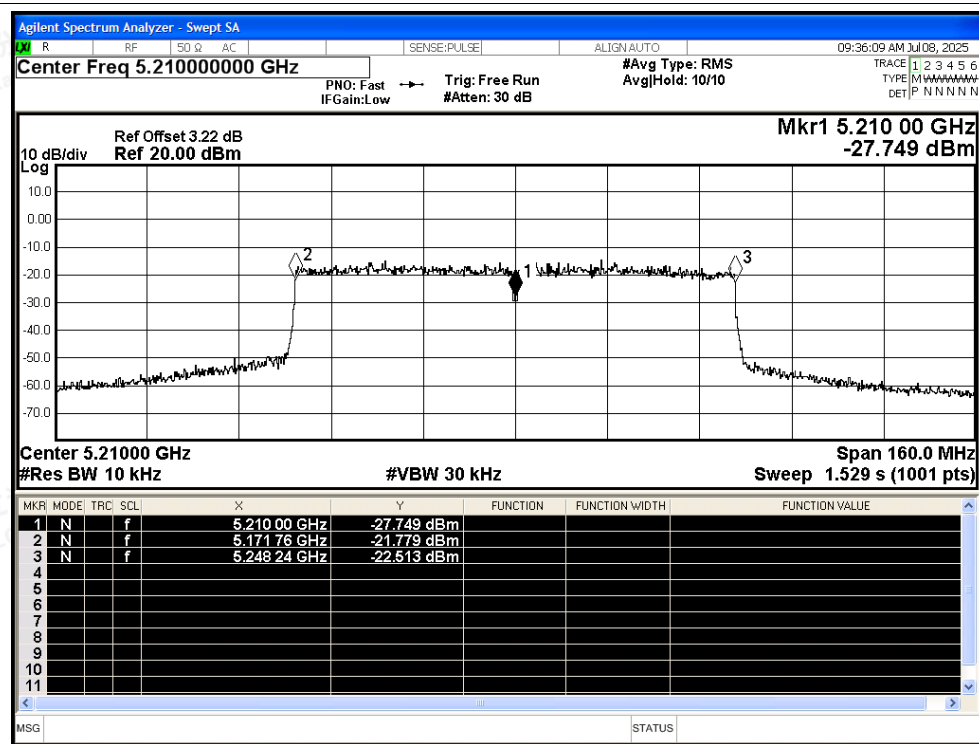

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5180MHz Ant1

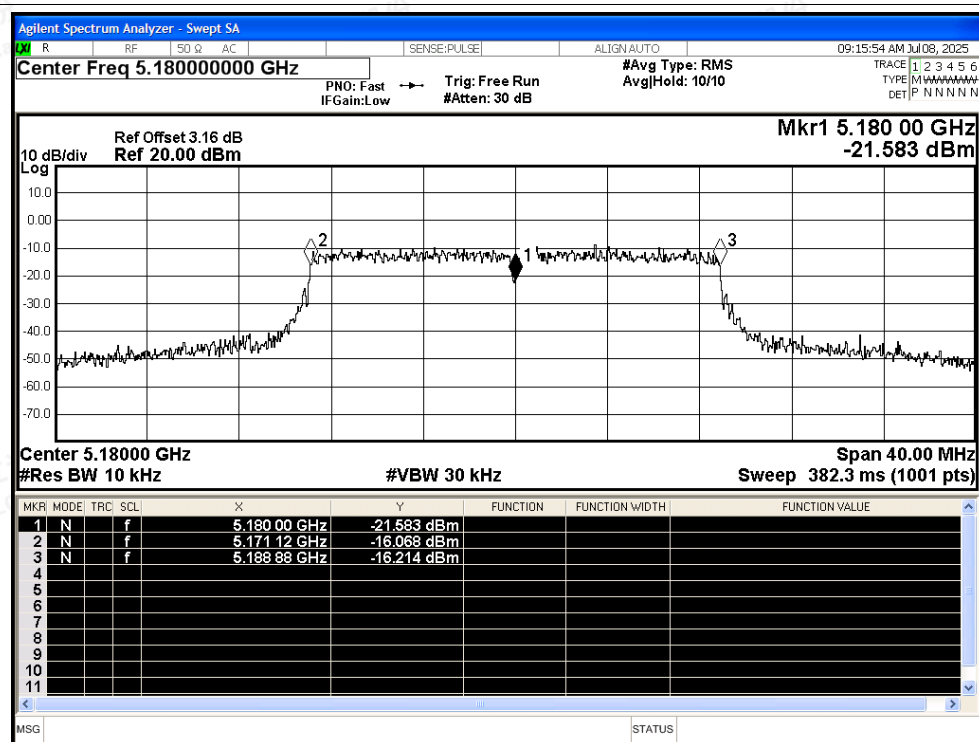

## Freq. Stability NVNT ax20 5200MHz Ant1

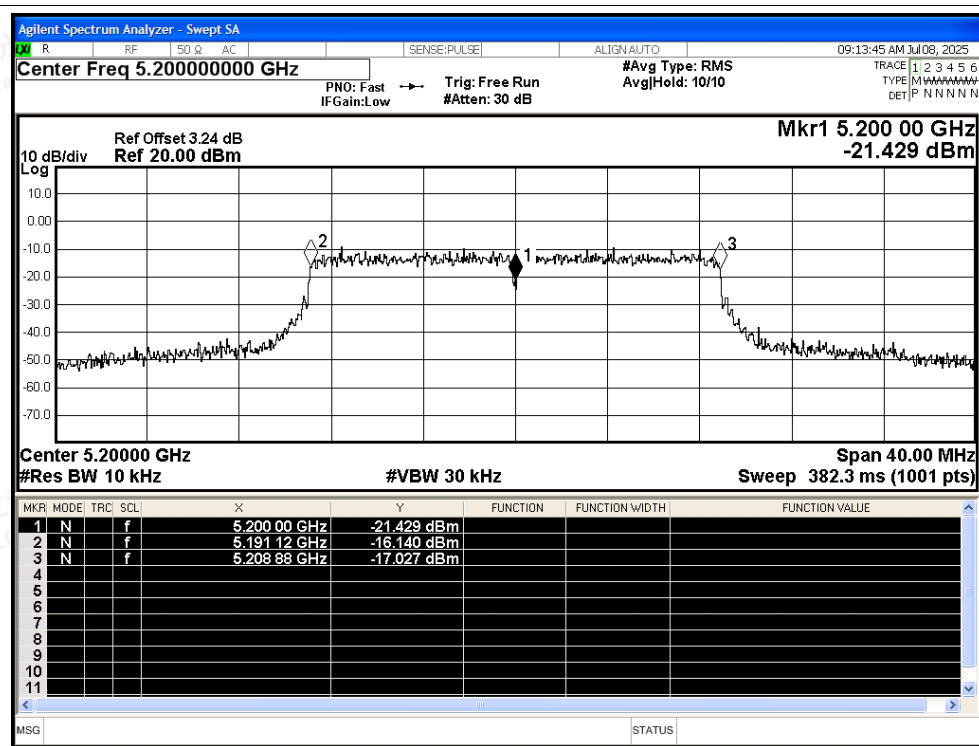

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5240MHz Ant1

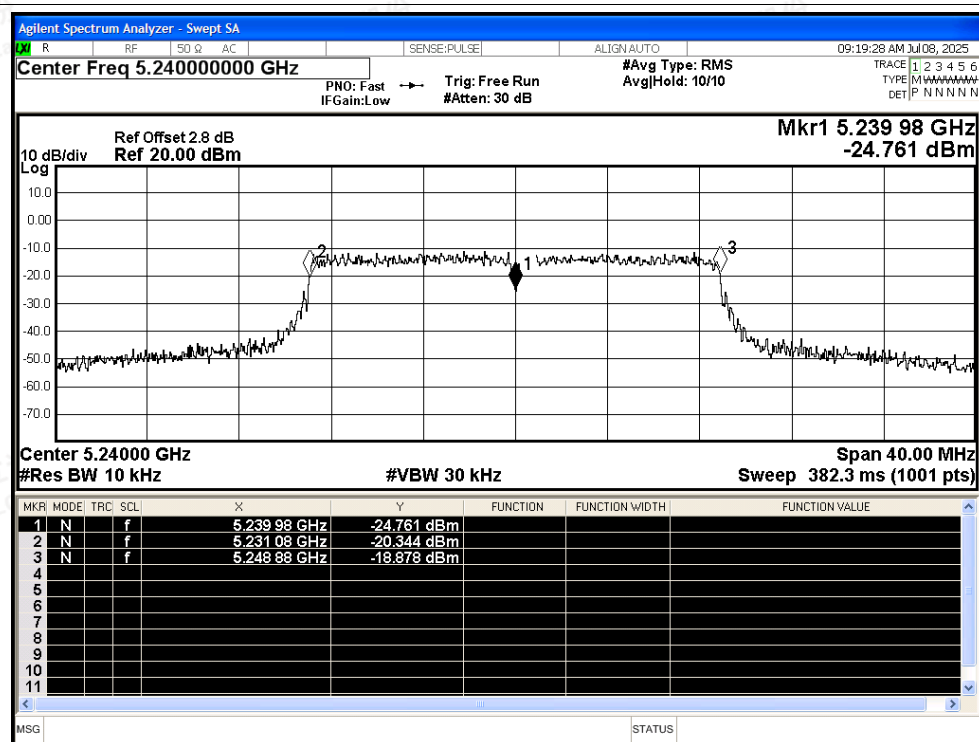

## Freq. Stability NVNT ax40 5190MHz Ant1

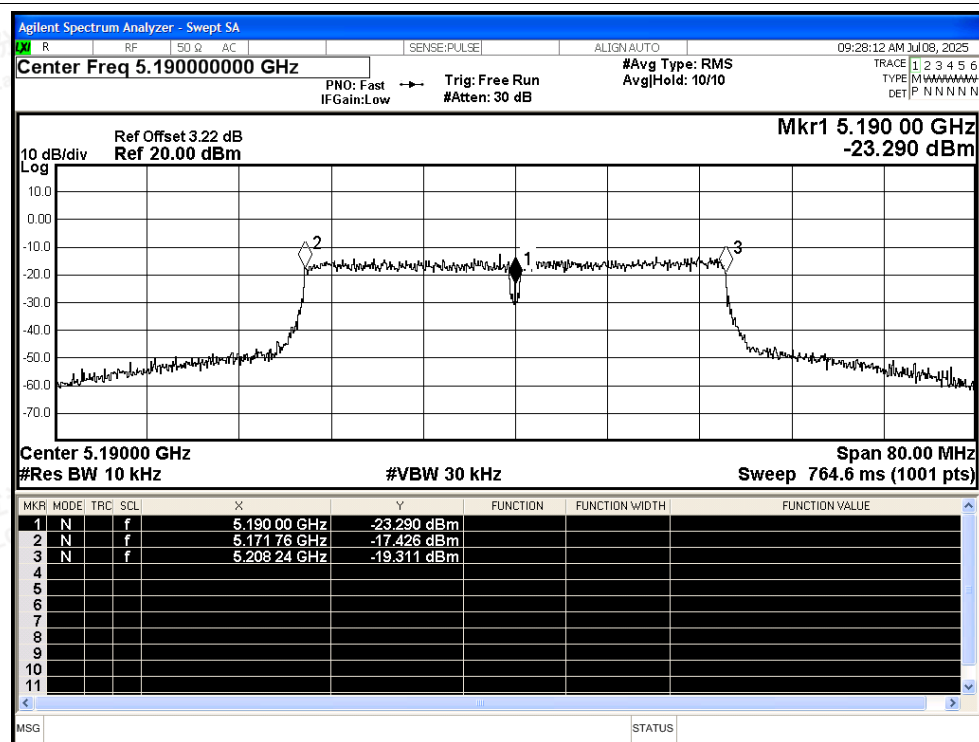

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax40 5230MHz Ant1

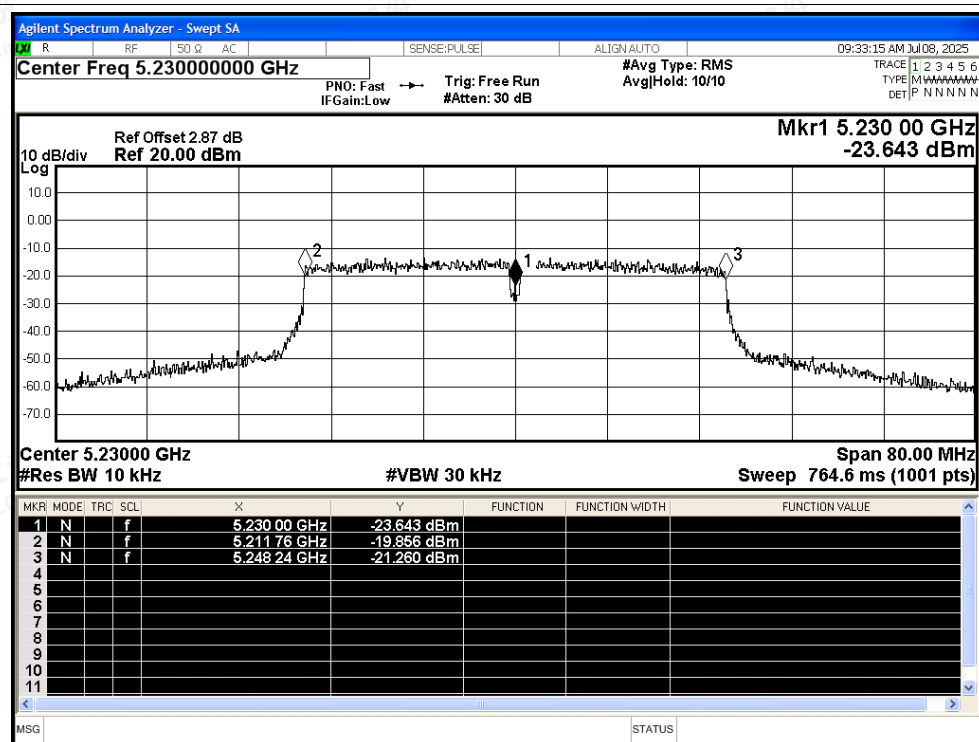

## Freq. Stability NVNT ax80 5210MHz Ant1

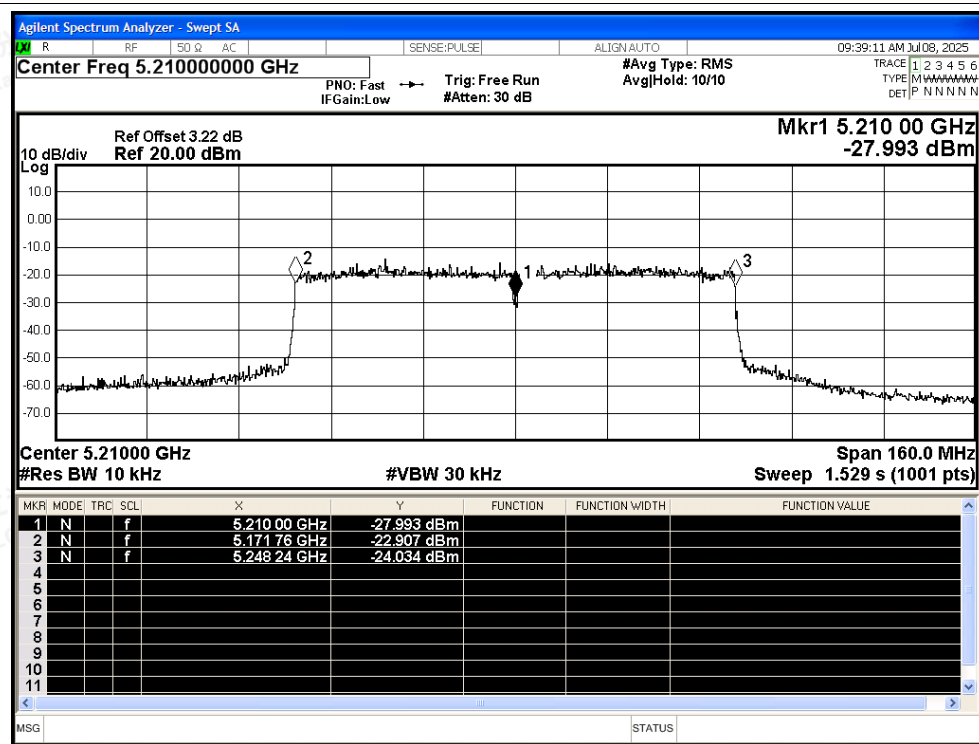

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5180            | Ant2    | 5179.98                  | -20000               | -3.86           | 25          | Pass    |
| NVNT      | a    | 5200            | Ant2    | 5200                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a    | 5240            | Ant2    | 5240                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n20  | 5180            | Ant2    | 5180                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n20  | 5200            | Ant2    | 5200                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n20  | 5240            | Ant2    | 5240                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40  | 5190            | Ant2    | 5190                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40  | 5230            | Ant2    | 5230                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5180            | Ant2    | 5180                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5200            | Ant2    | 5200.02                  | 20000                | 3.85            | 25          | Pass    |
| NVNT      | ac20 | 5240            | Ant2    | 5239.98                  | -20000               | -3.82           | 25          | Pass    |
| NVNT      | ac40 | 5190            | Ant2    | 5190                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5230            | Ant2    | 5230                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac80 | 5210            | Ant2    | 5210                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5180            | Ant2    | 5179.98                  | -20000               | -3.86           | 25          | Pass    |
| NVNT      | ax20 | 5200            | Ant2    | 5200.02                  | 20000                | 3.85            | 25          | Pass    |
| NVNT      | ax20 | 5240            | Ant2    | 5240                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40 | 5190            | Ant2    | 5190                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40 | 5230            | Ant2    | 5230                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax80 | 5210            | Ant2    | 5210                     | 0                    | 0               | 25          | Pass    |






## Test Graphs

## Freq. Stability NVNT a 5180MHz Ant2

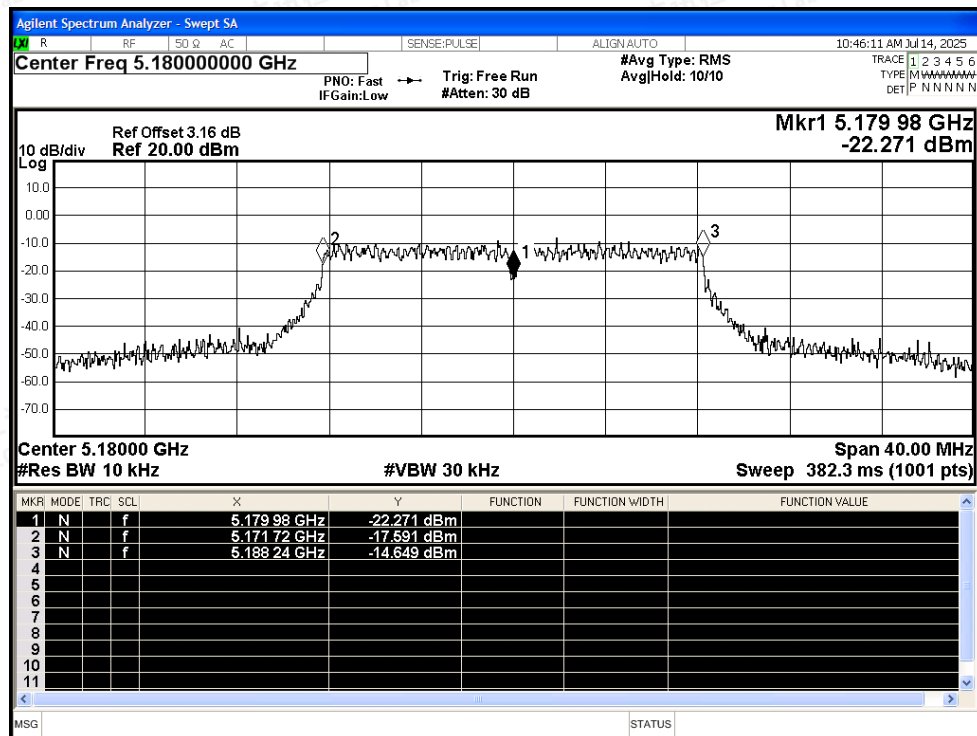

## Freq. Stability NVNT a 5200MHz Ant2

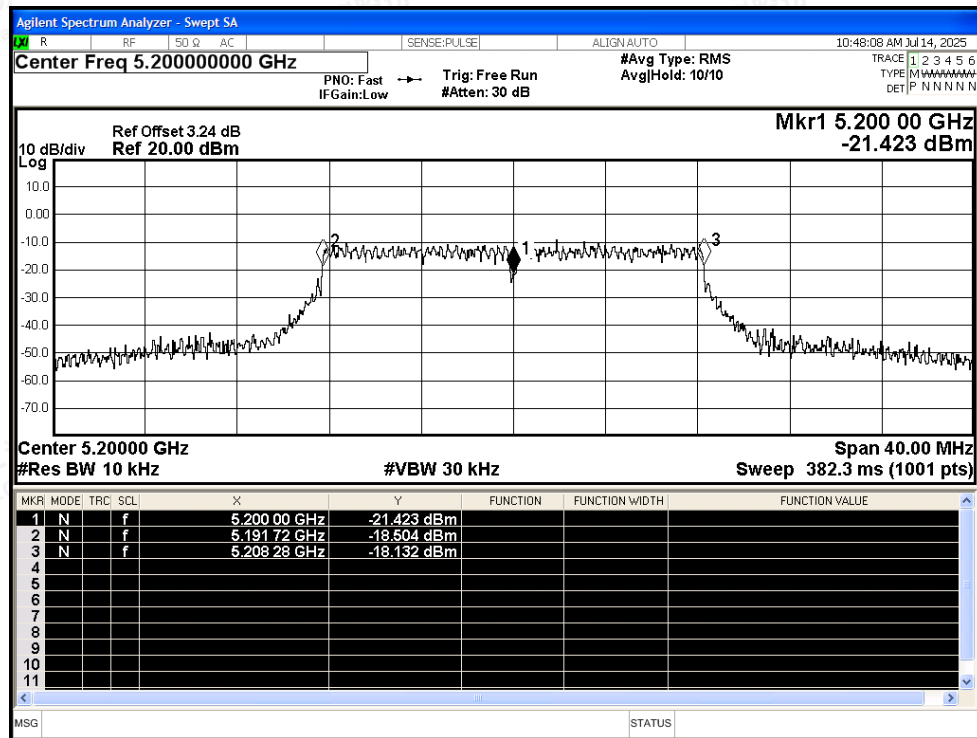

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT a 5240MHz Ant2

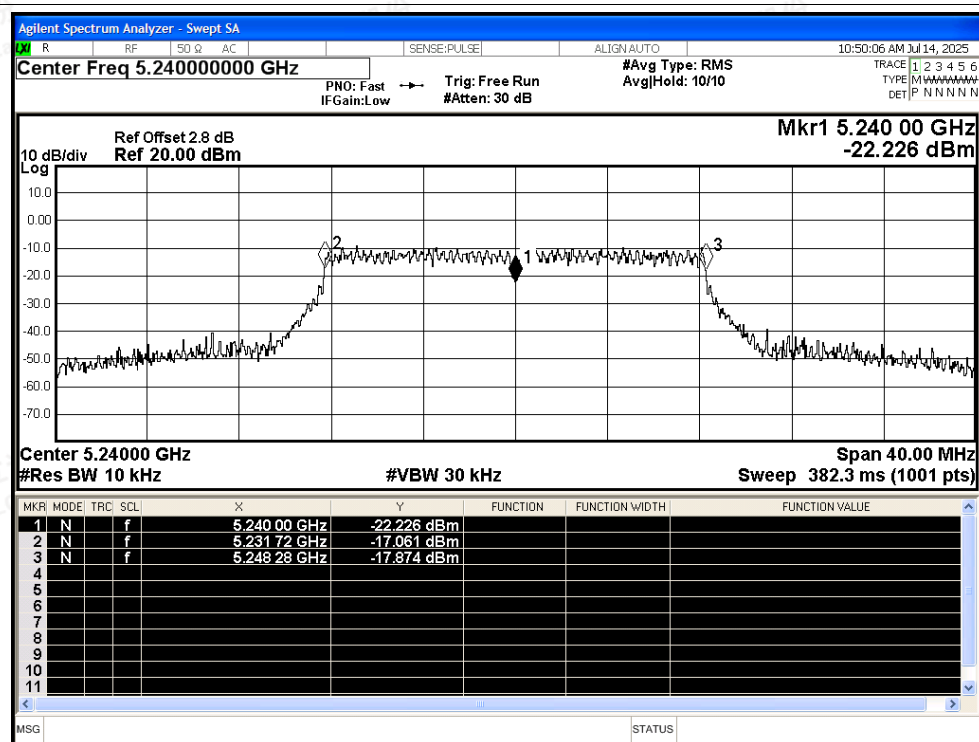

## Freq. Stability NVNT n20 5180MHz Ant2

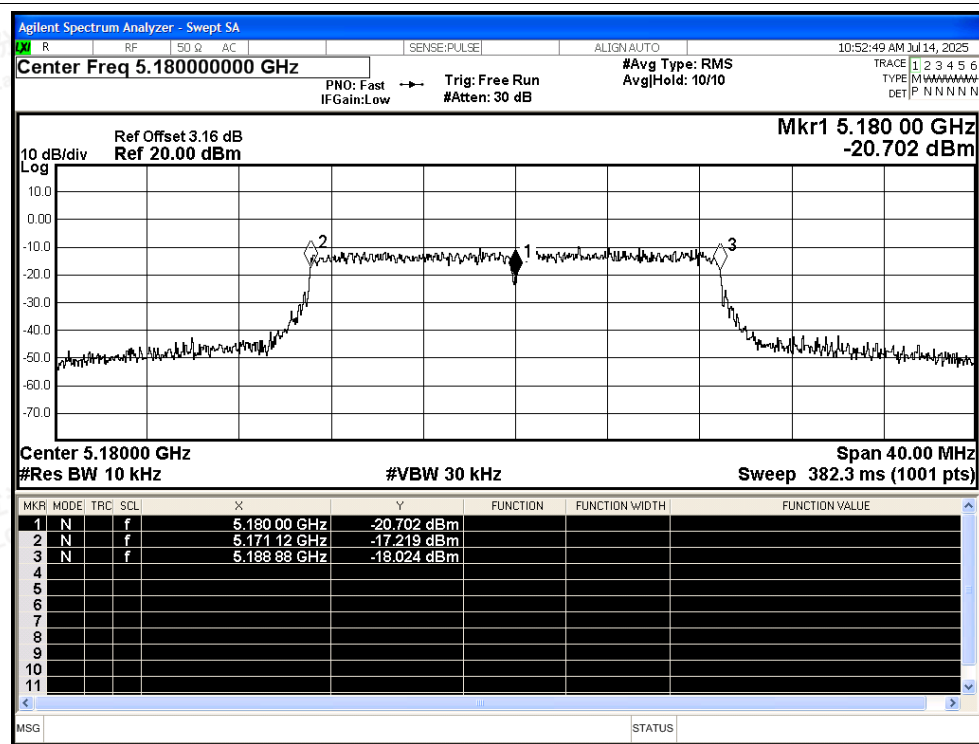

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n20 5200MHz Ant2

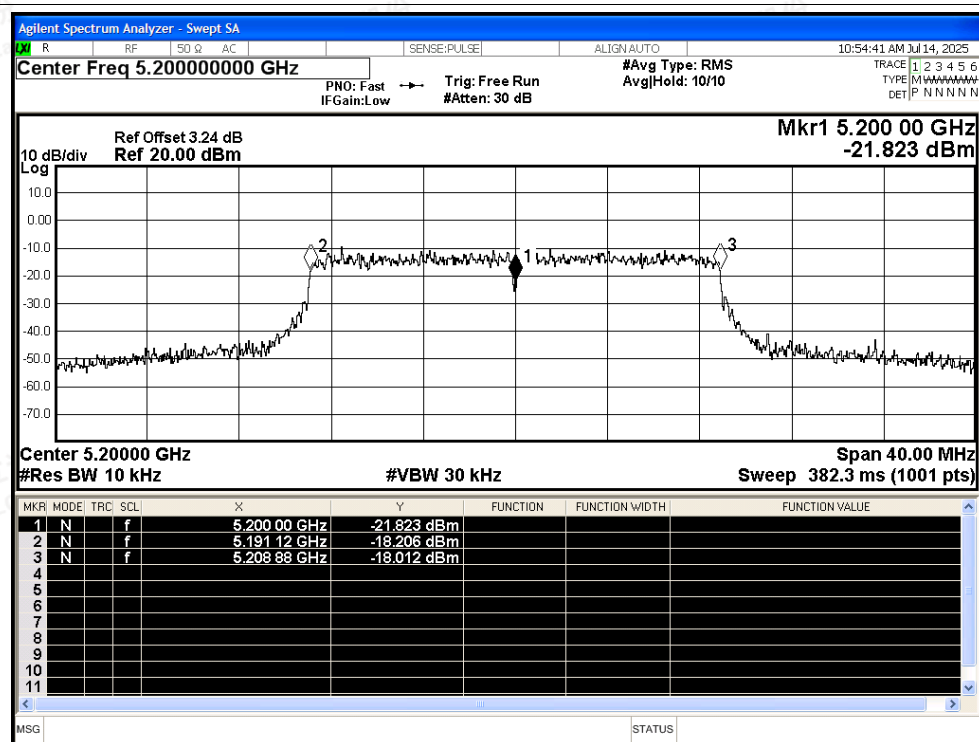

## Freq. Stability NVNT n20 5240MHz Ant2

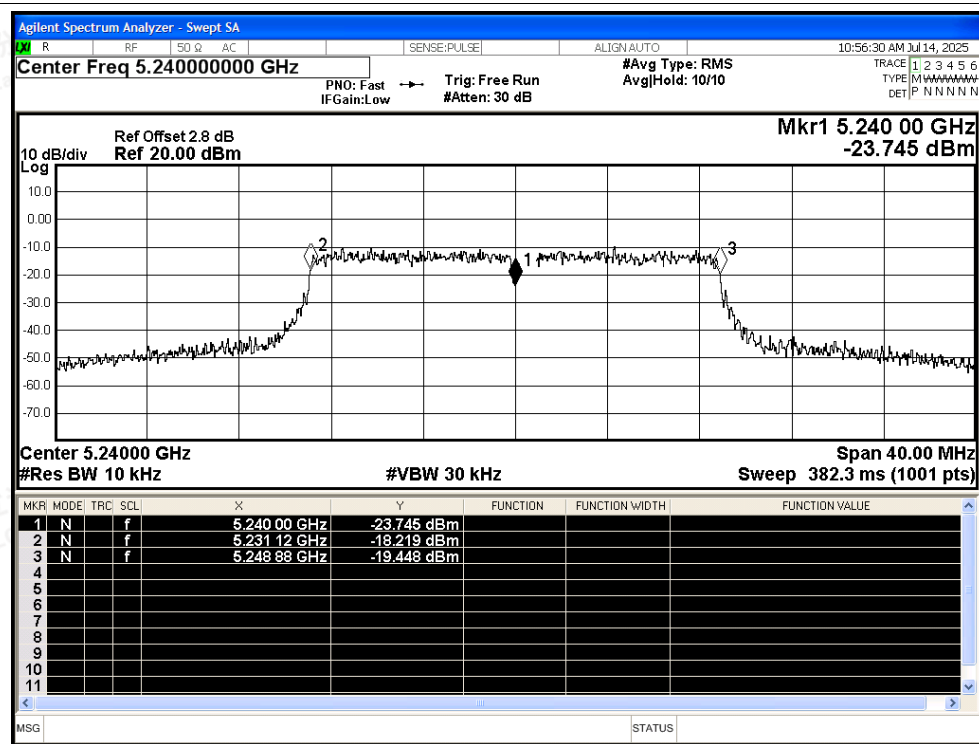

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5190MHz Ant2

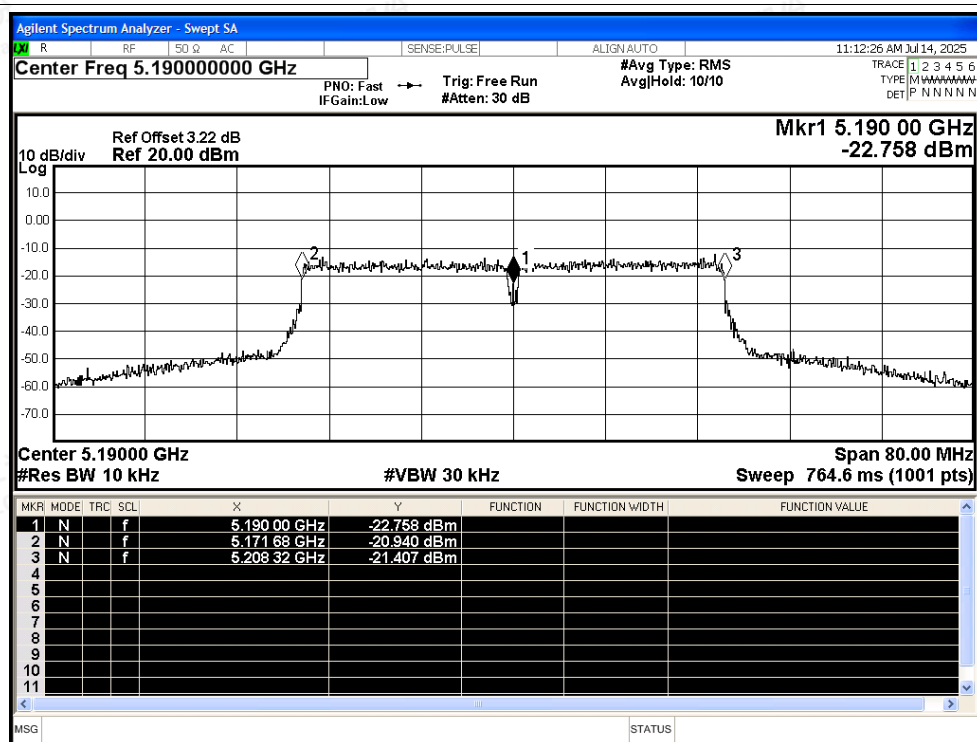

## Freq. Stability NVNT n40 5230MHz Ant2

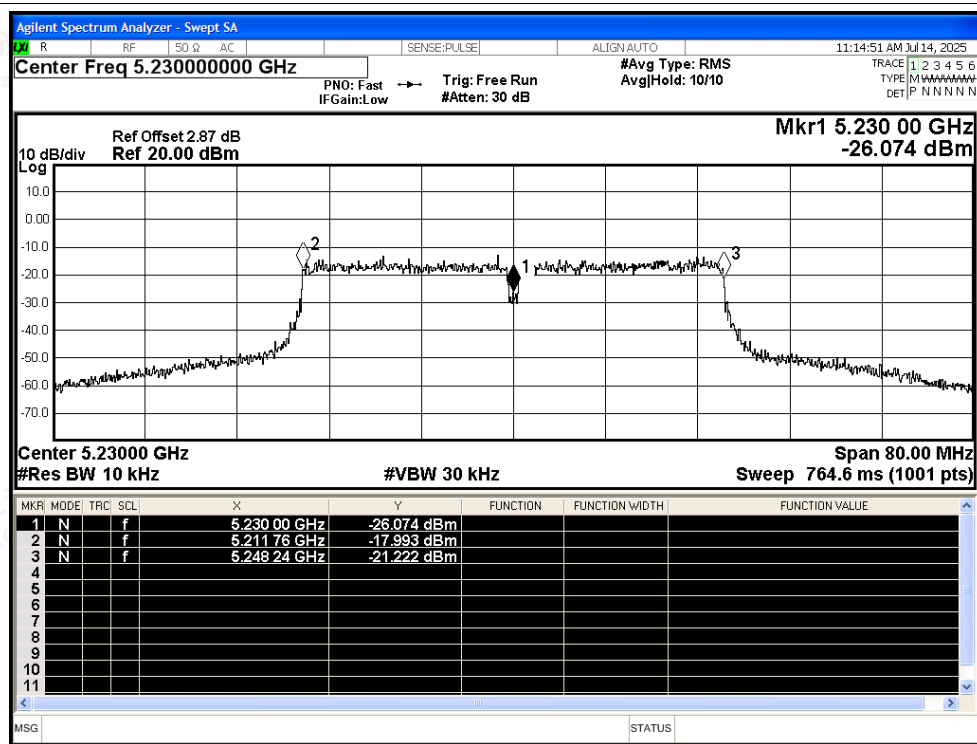

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5180MHz Ant2

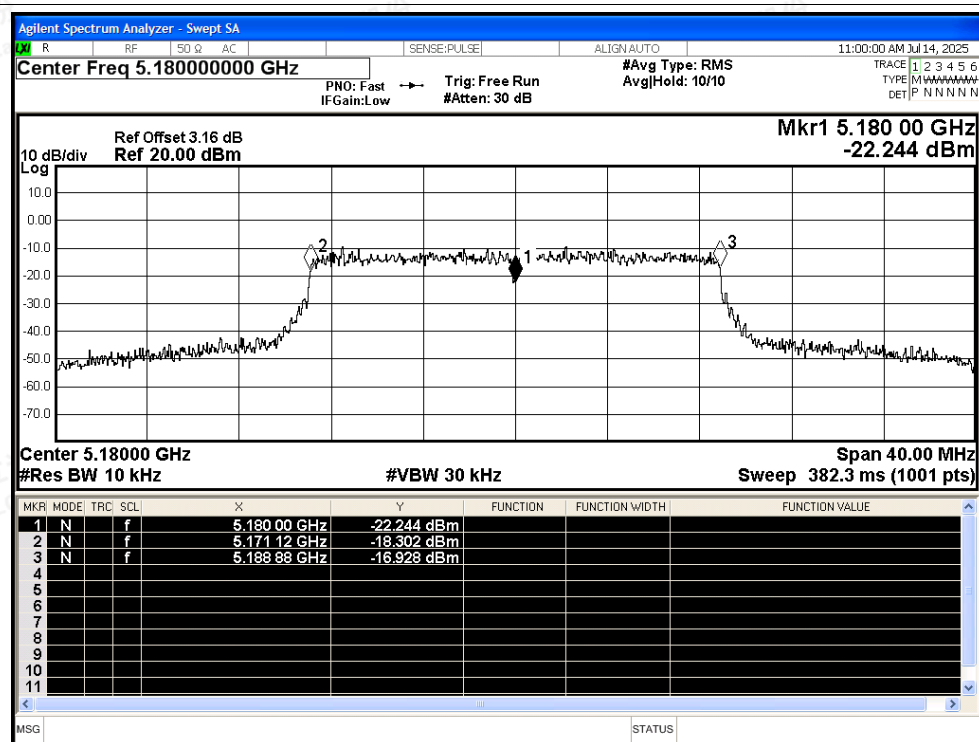

## Freq. Stability NVNT ac20 5200MHz Ant2

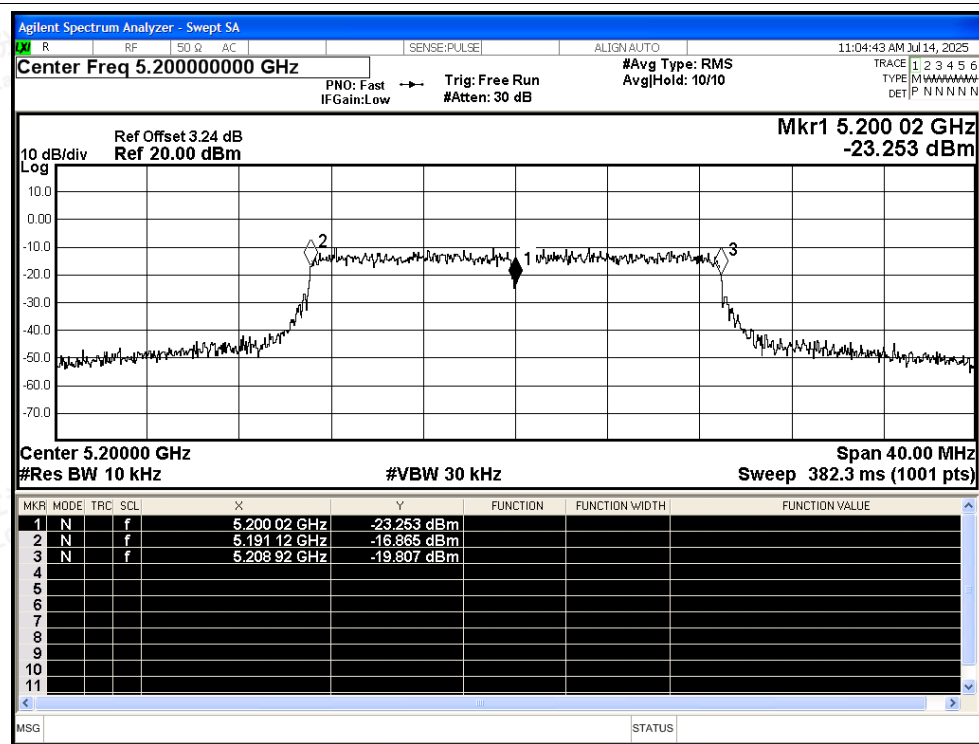

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5240MHz Ant2

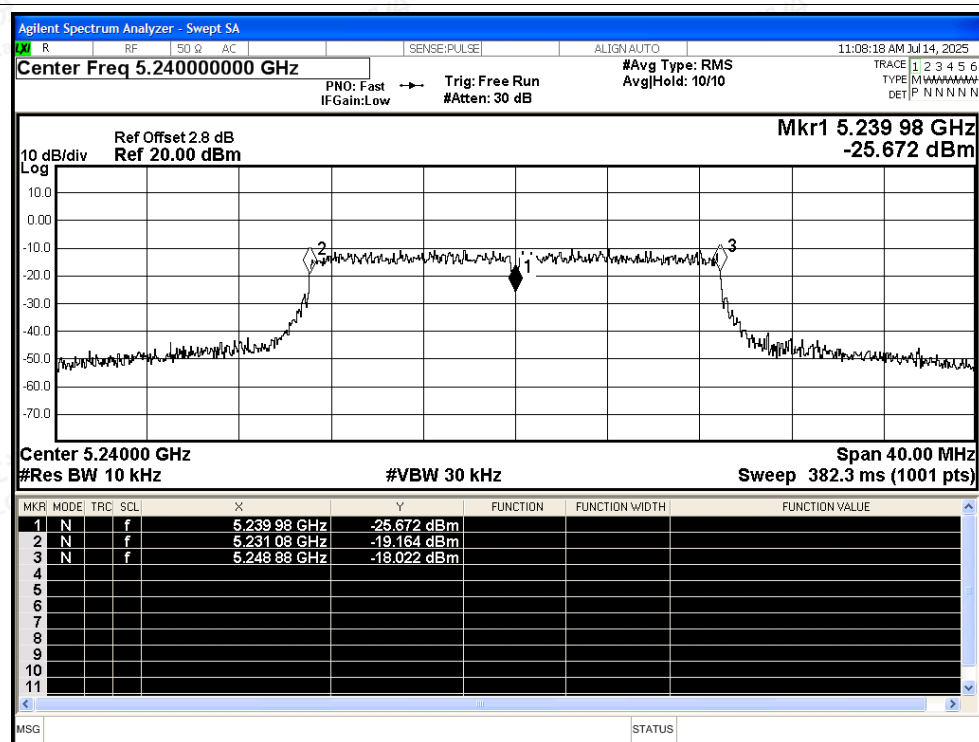

## Freq. Stability NVNT ac40 5190MHz Ant2

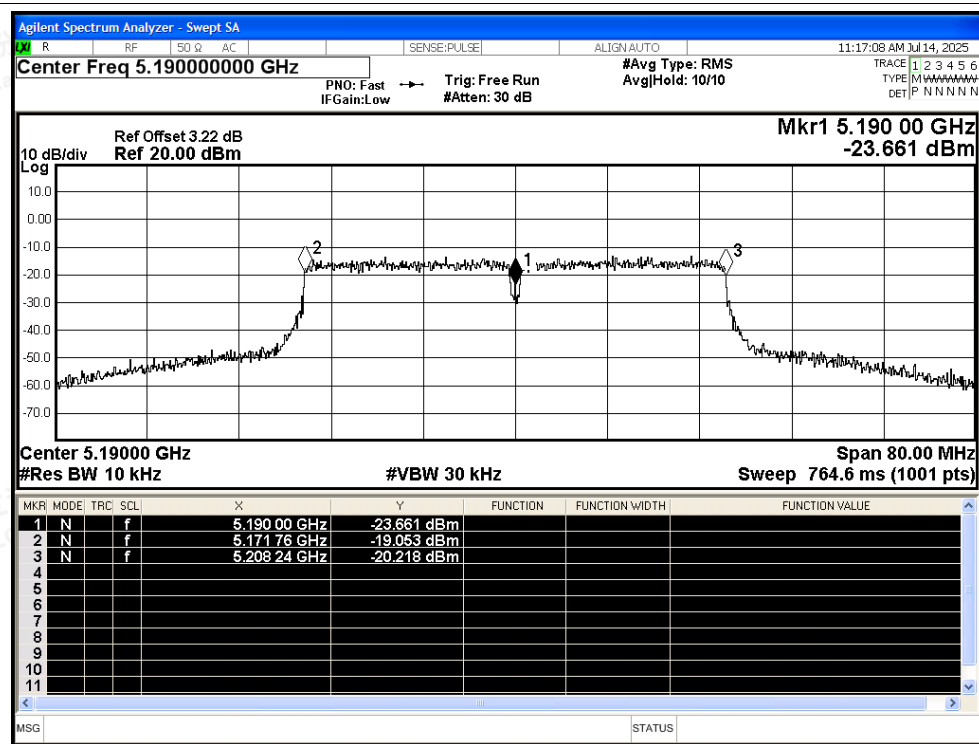

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac40 5230MHz Ant2

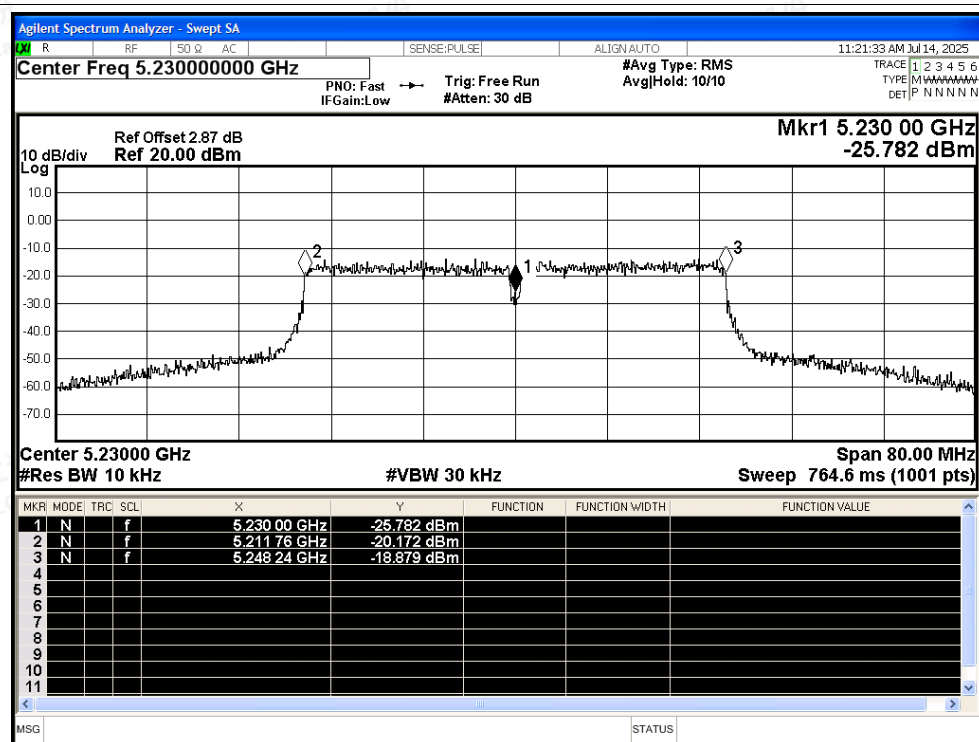

## Freq. Stability NVNT ac80 5210MHz Ant2

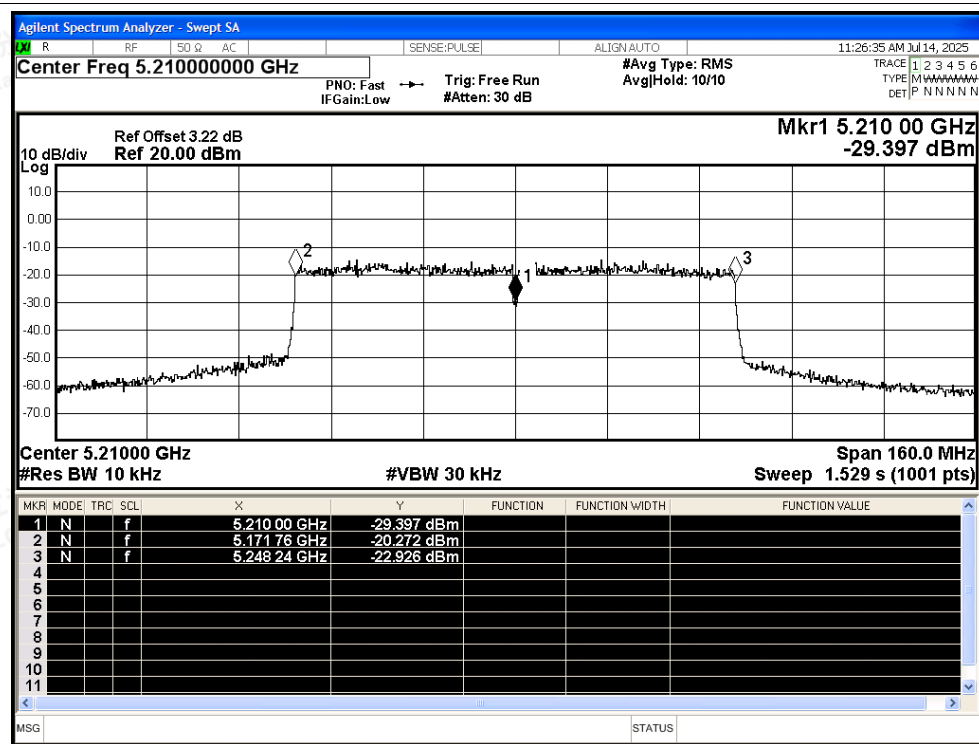

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5180MHz Ant2

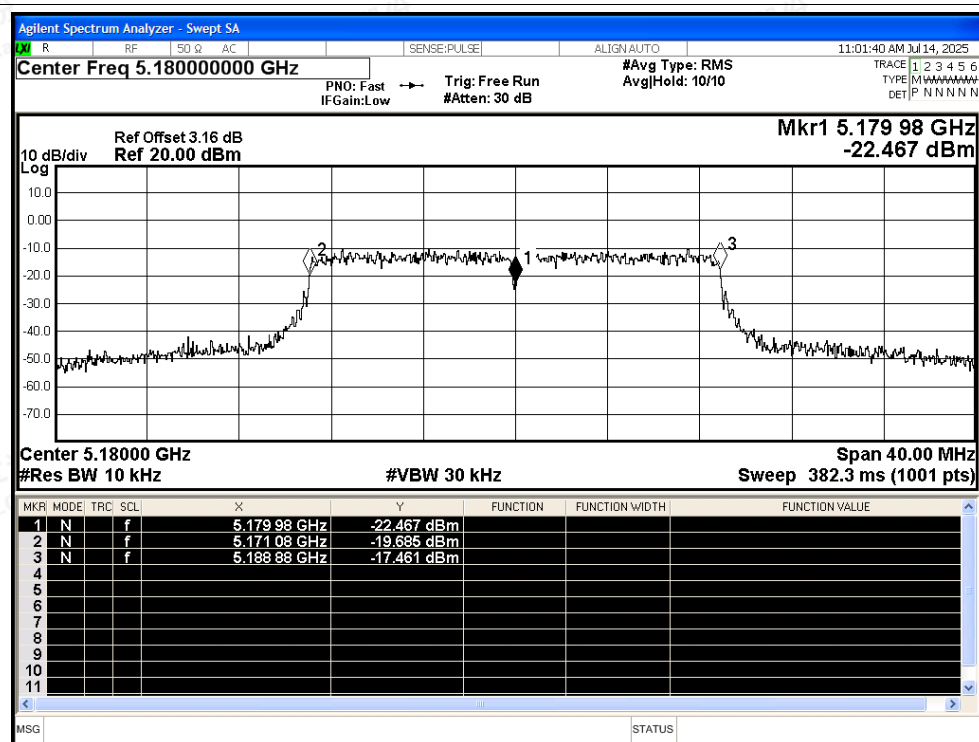

## Freq. Stability NVNT ax20 5200MHz Ant2

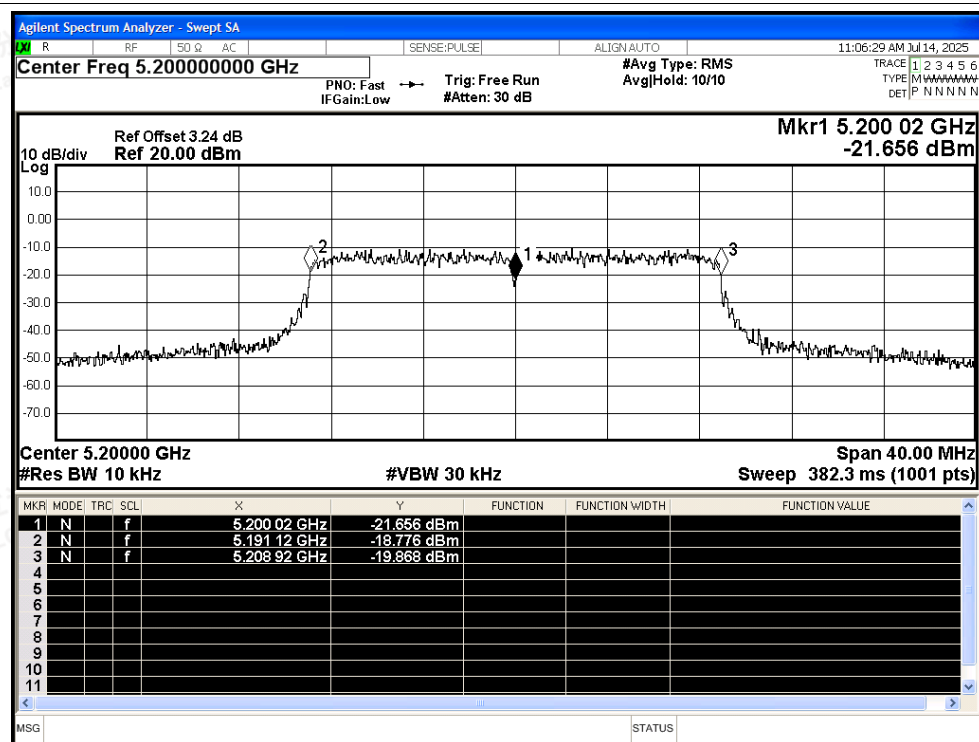

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5240MHz Ant2

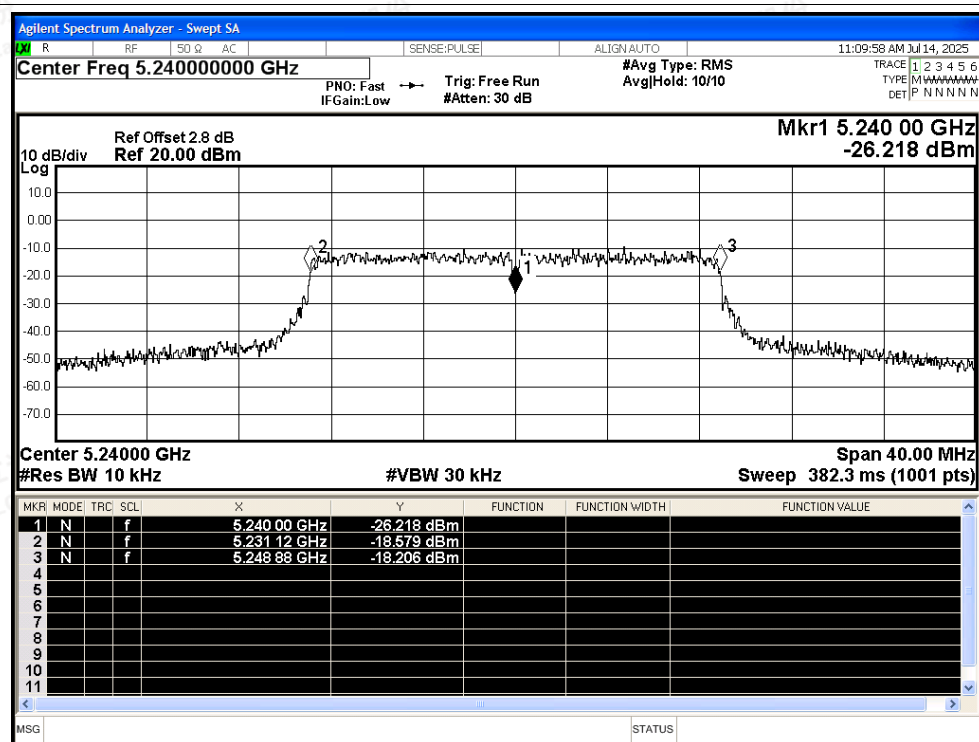

## Freq. Stability NVNT ax40 5190MHz Ant2

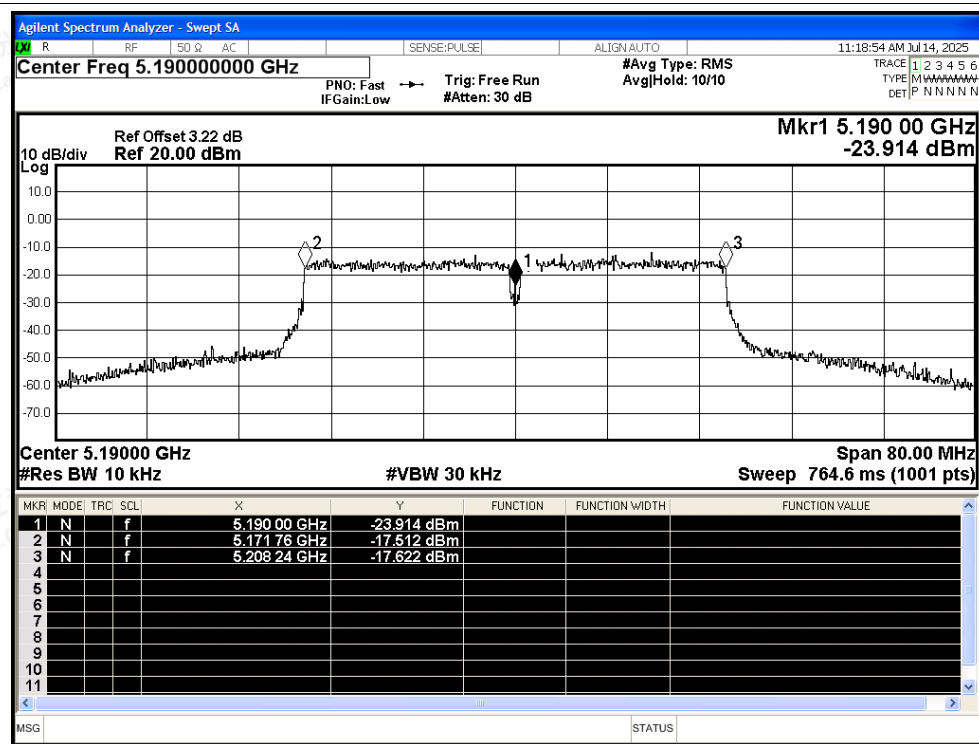

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax40 5230MHz Ant2

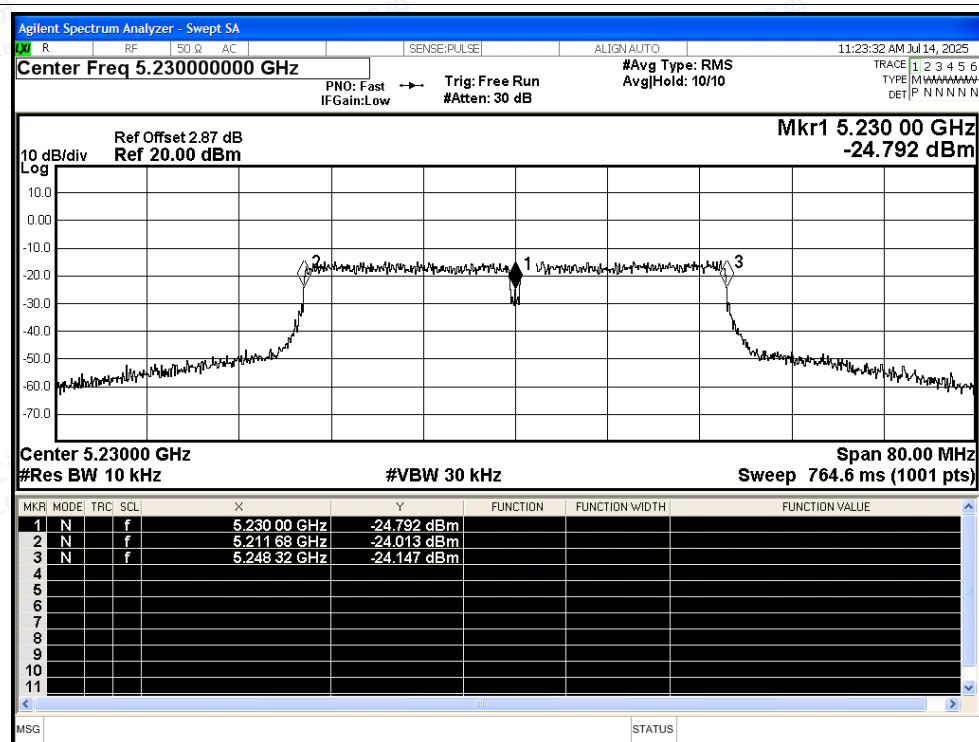

## Freq. Stability NVNT ax80 5210MHz Ant2

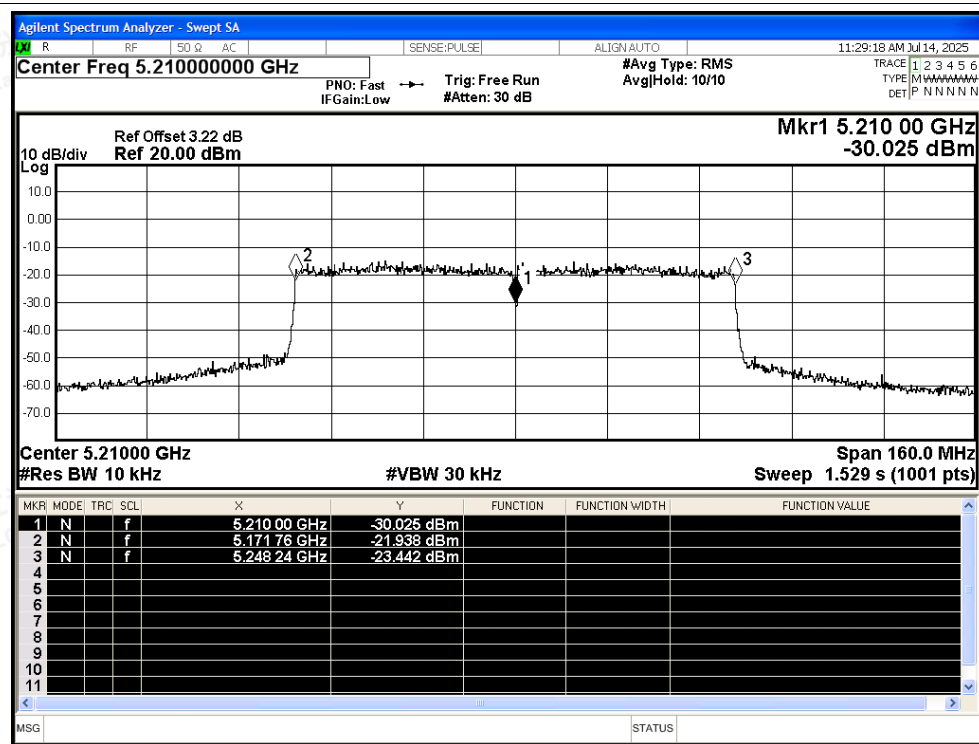

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## D.6 Duty Cycle


| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5180            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5200            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5240            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | n20  | 5180            | Ant1    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20  | 5200            | Ant1    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20  | 5240            | Ant1    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n40  | 5190            | Ant1    | 94.71          | 0.24                   | 0.9       |
| NVNT      | n40  | 5230            | Ant1    | 94.71          | 0.24                   | 0.9       |
| NVNT      | ac20 | 5180            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac20 | 5200            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac20 | 5240            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac40 | 5190            | Ant1    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ac40 | 5230            | Ant1    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ac80 | 5210            | Ant1    | 89.65          | 0.47                   | 1.86      |
| NVNT      | ax20 | 5180            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20 | 5200            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20 | 5240            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax40 | 5190            | Ant1    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ax40 | 5230            | Ant1    | 94.81          | 0.23                   | 0.9       |
| NVNT      | ax80 | 5210            | Ant1    | 89.65          | 0.47                   | 1.86      |






## Test Graphs

## Duty Cycle NVNT a 5180MHz Ant1

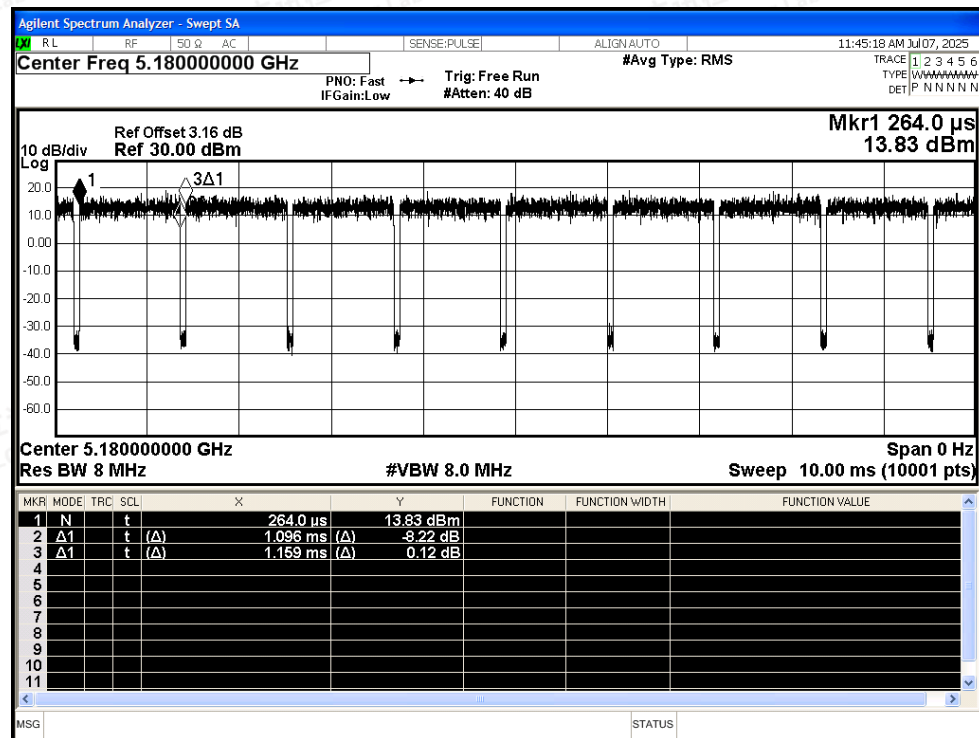

## Duty Cycle NVNT a 5200MHz Ant1

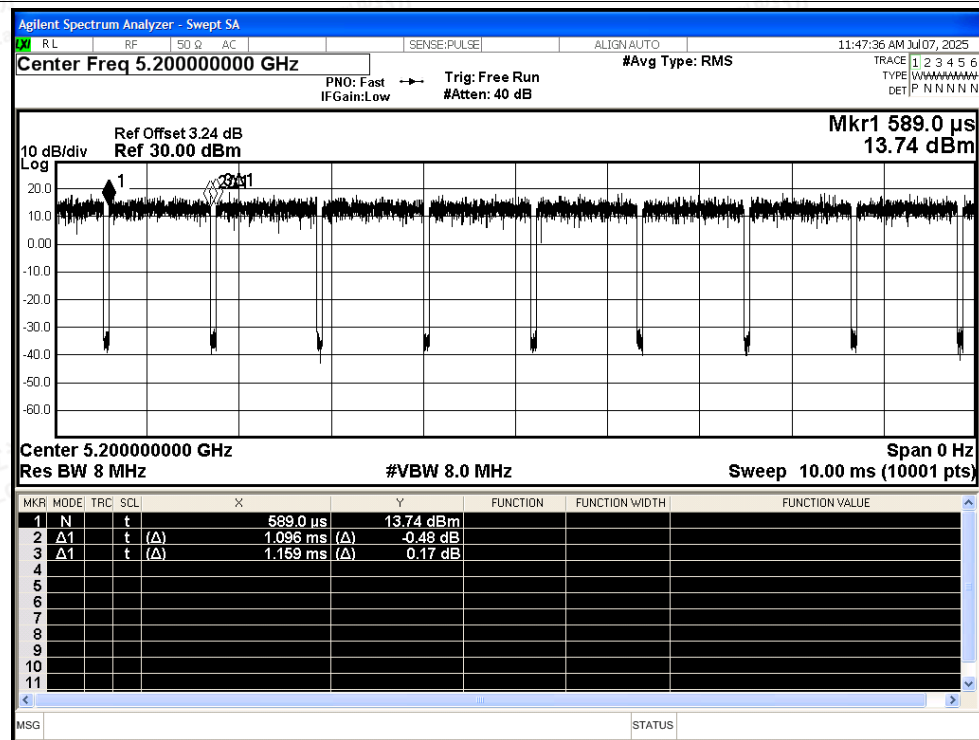

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5240MHz Ant1

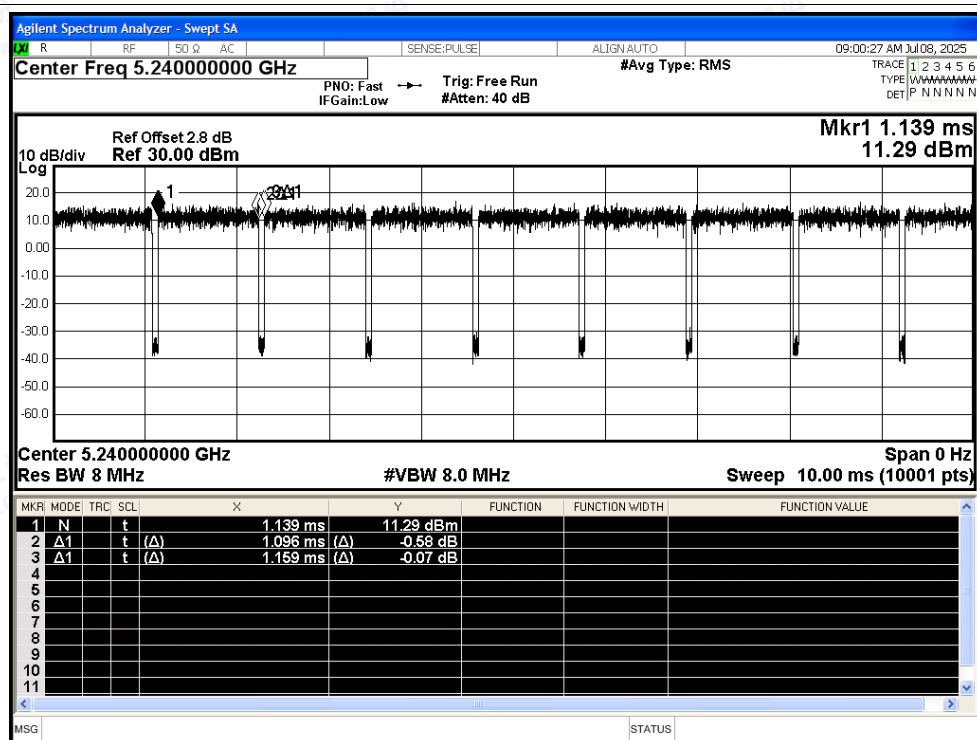

## Duty Cycle NVNT n20 5180MHz Ant1

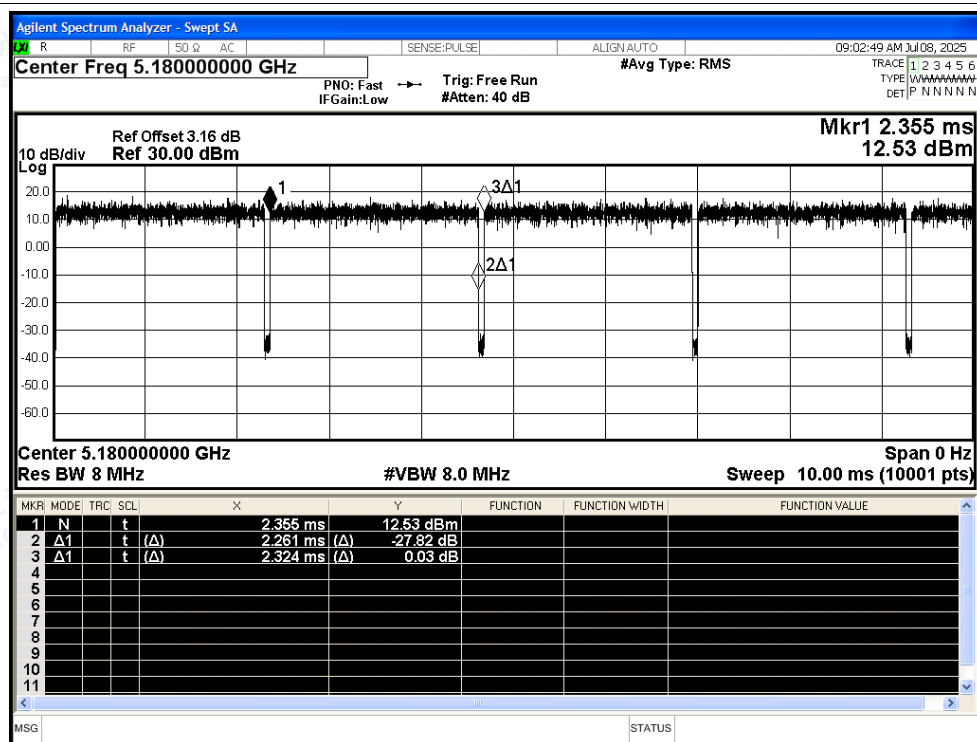

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n20 5200MHz Ant1

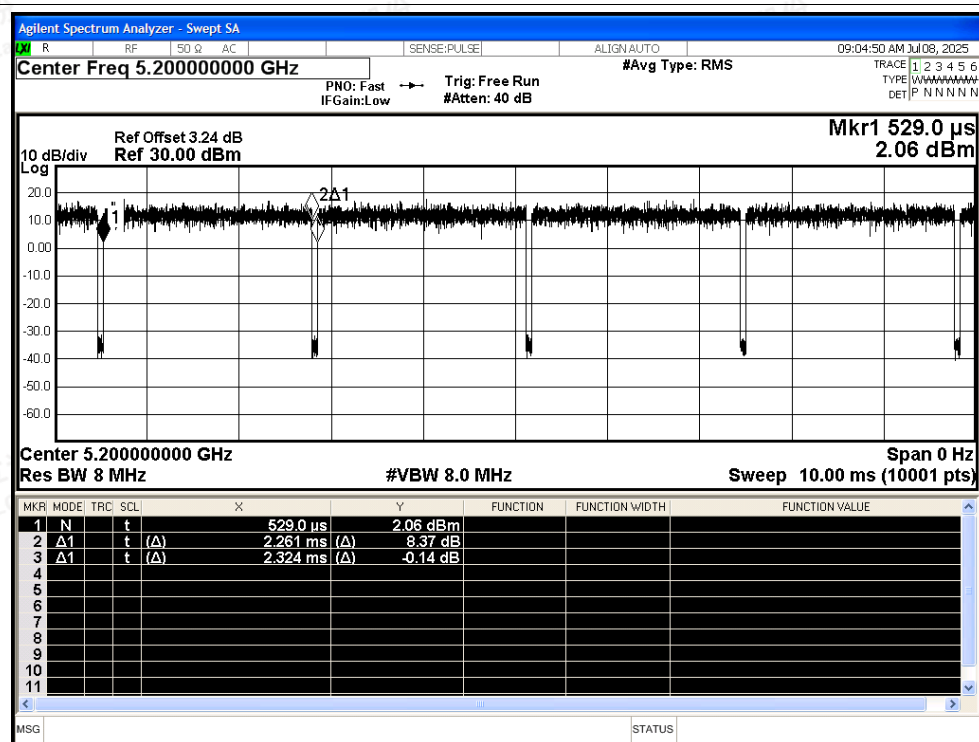

## Duty Cycle NVNT n20 5240MHz Ant1

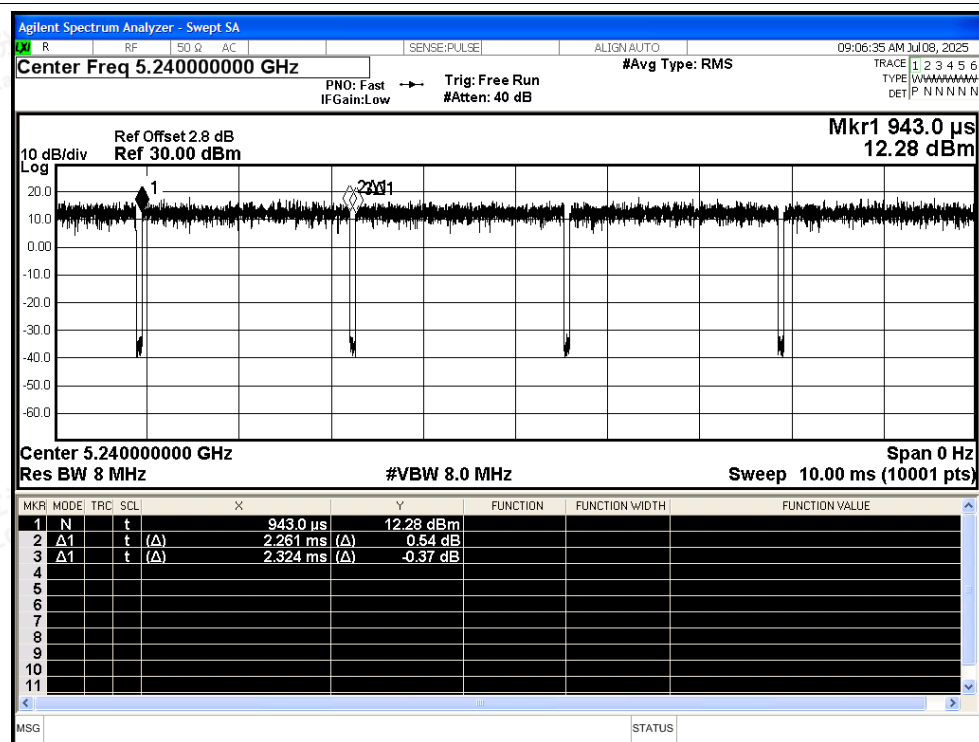

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5190MHz Ant1

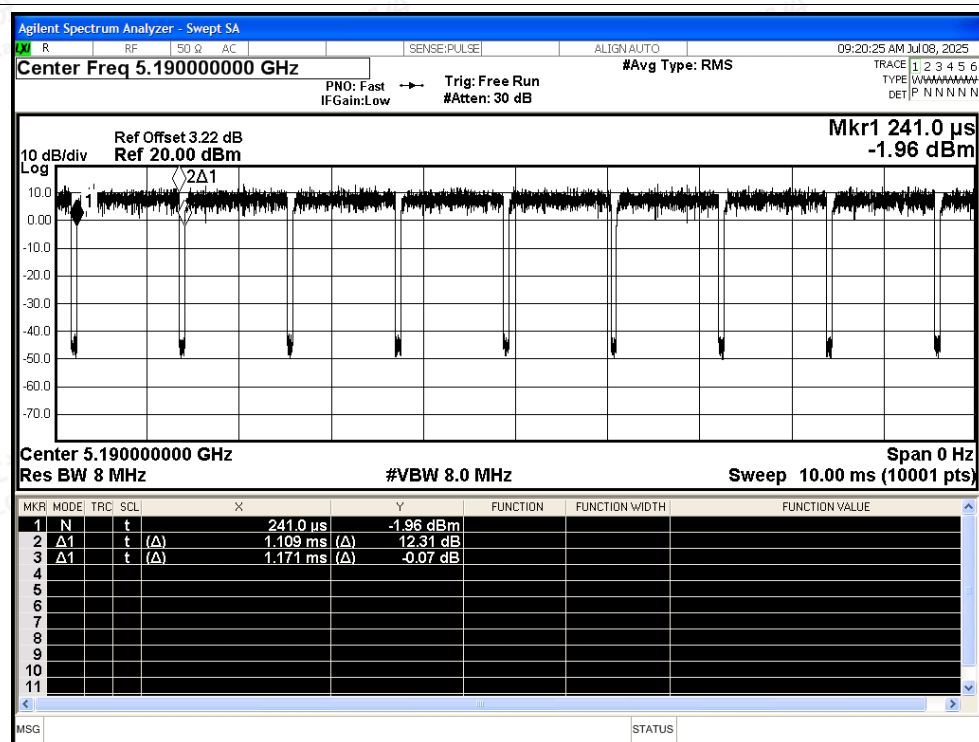

## Duty Cycle NVNT n40 5230MHz Ant1

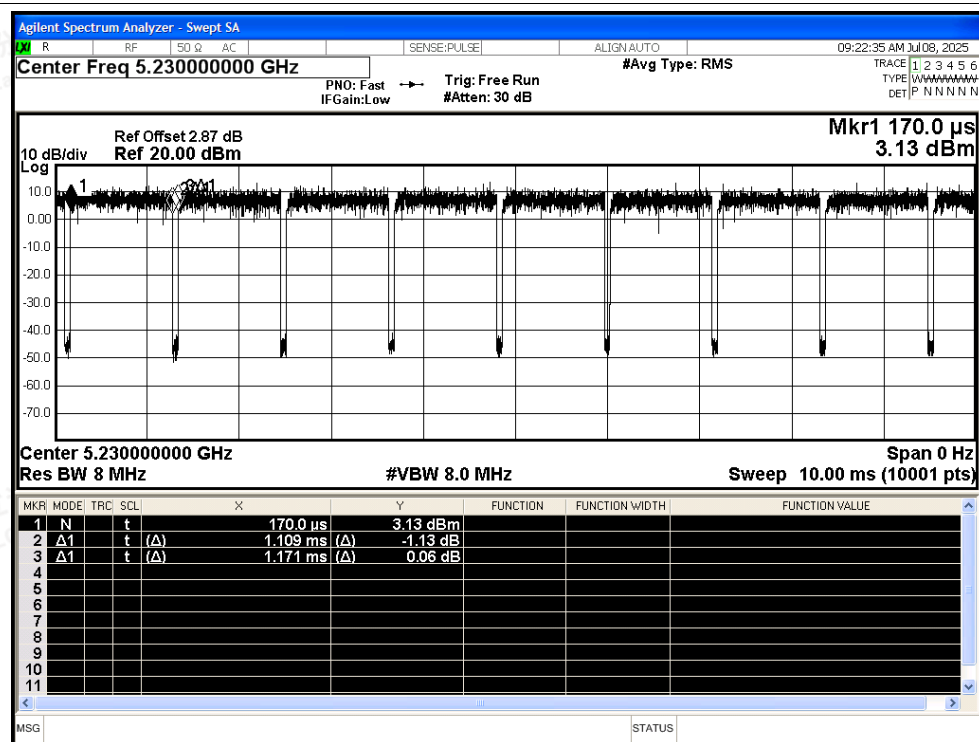

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5180MHz Ant1

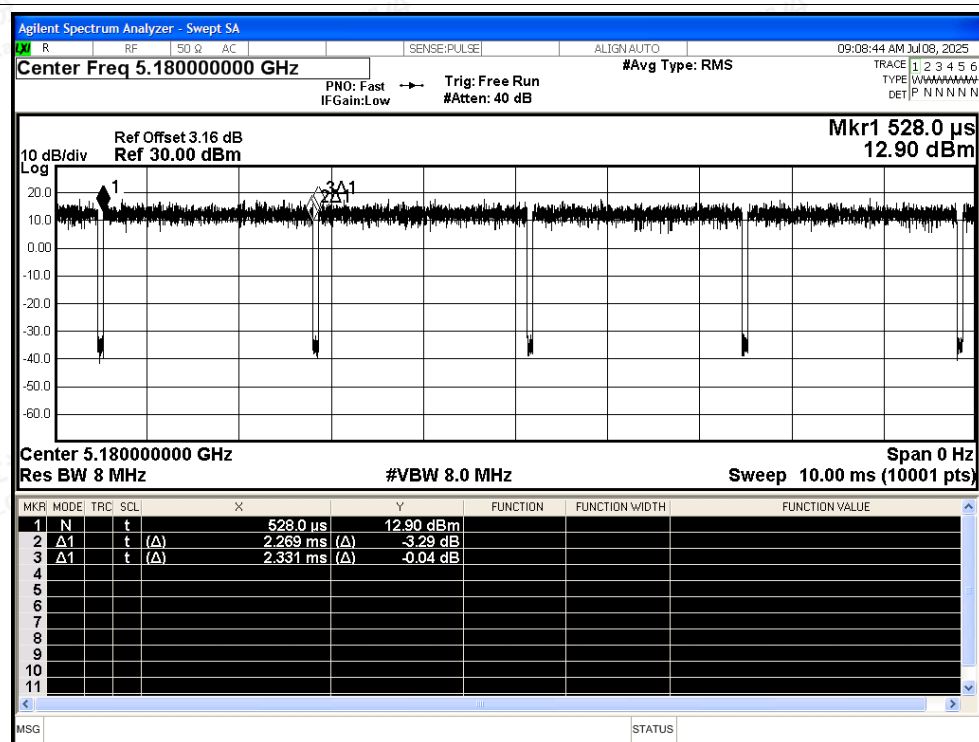

## Duty Cycle NVNT ac20 5200MHz Ant1

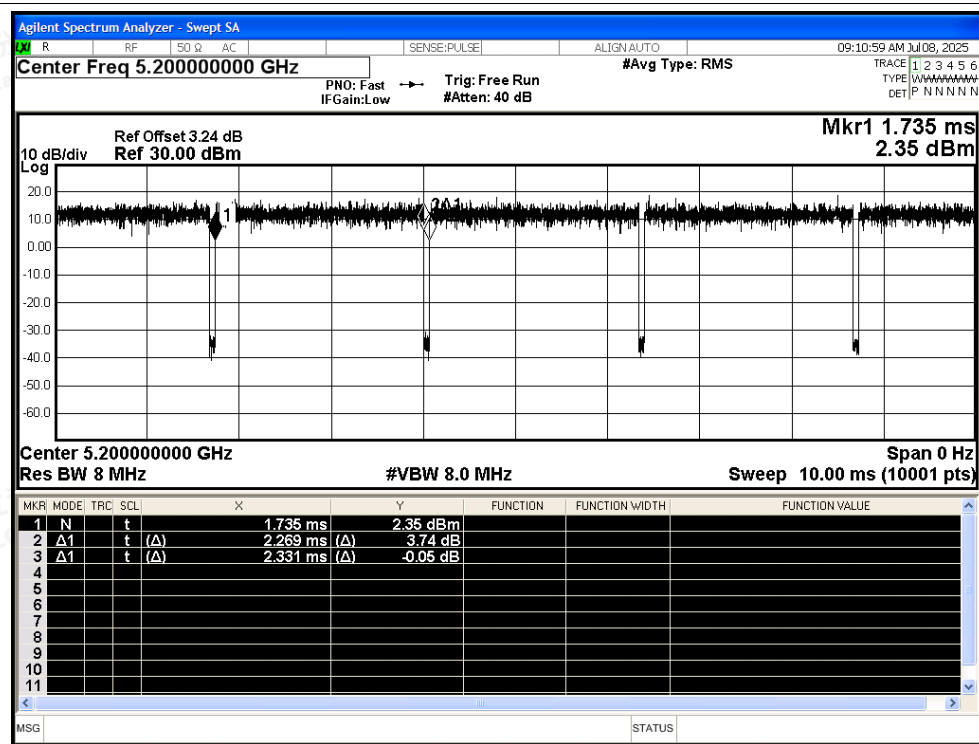

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5240MHz Ant1

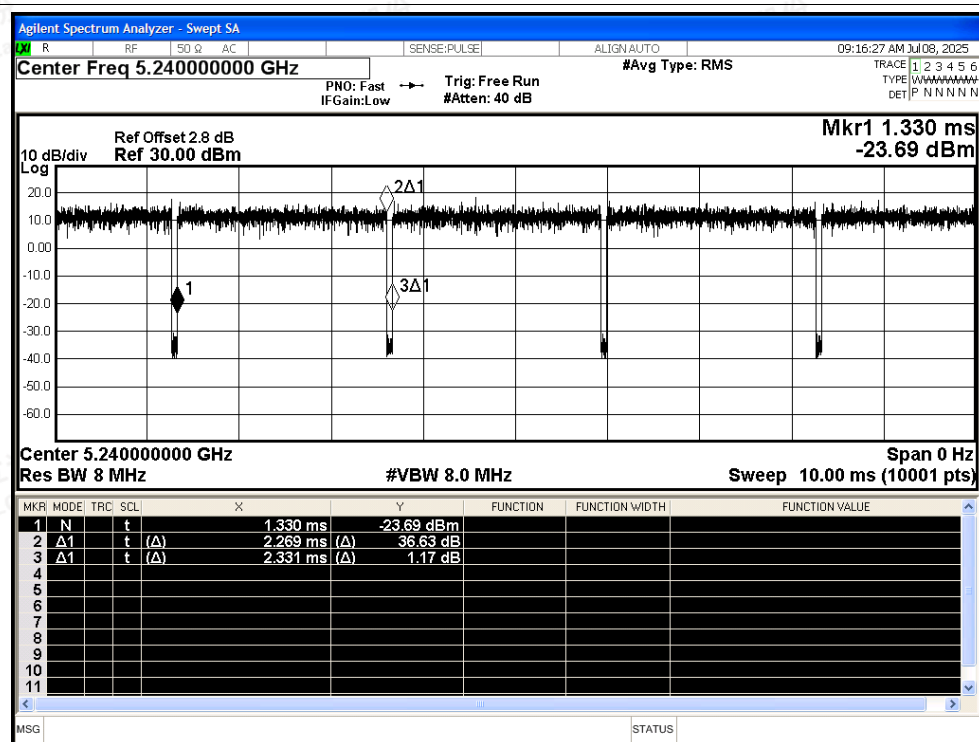

## Duty Cycle NVNT ac40 5190MHz Ant1

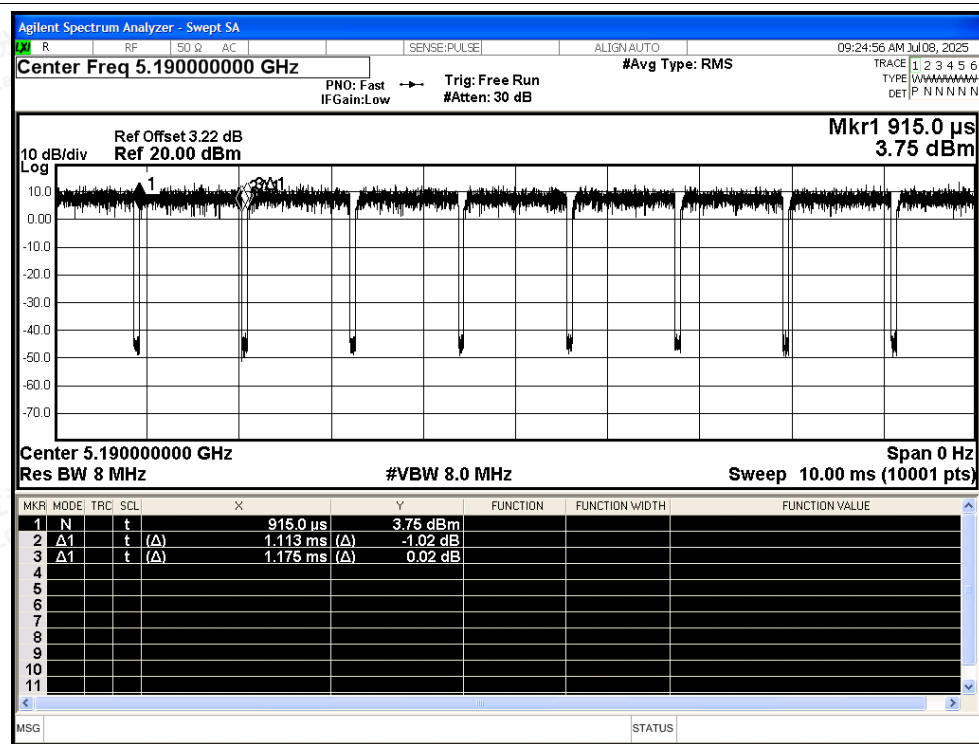

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5230MHz Ant1

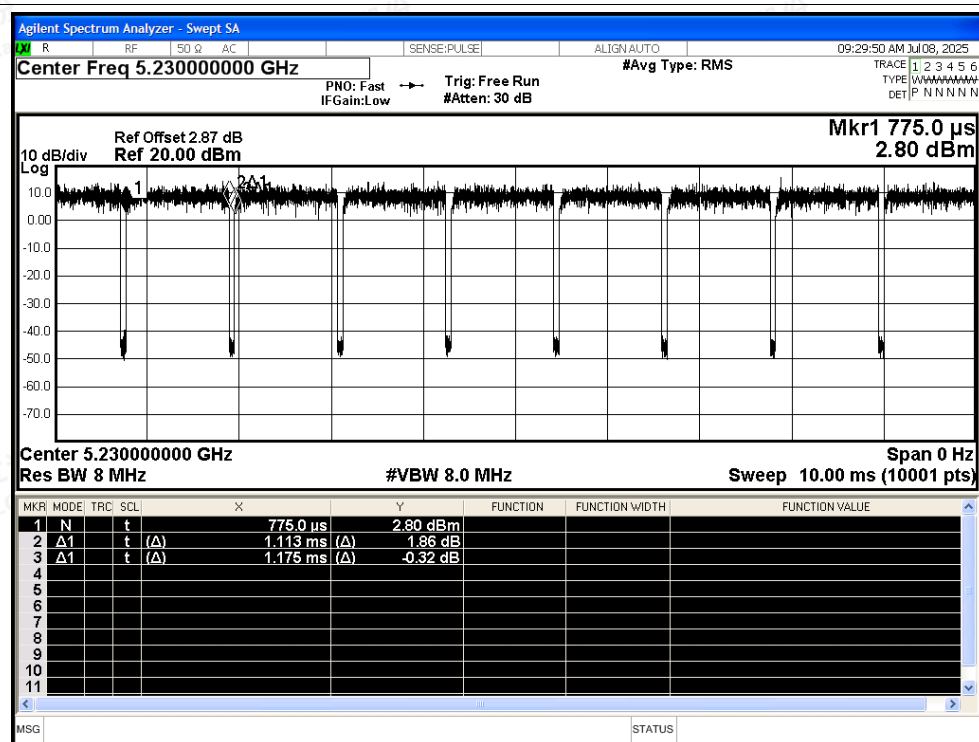

## Duty Cycle NVNT ac80 5210MHz Ant1

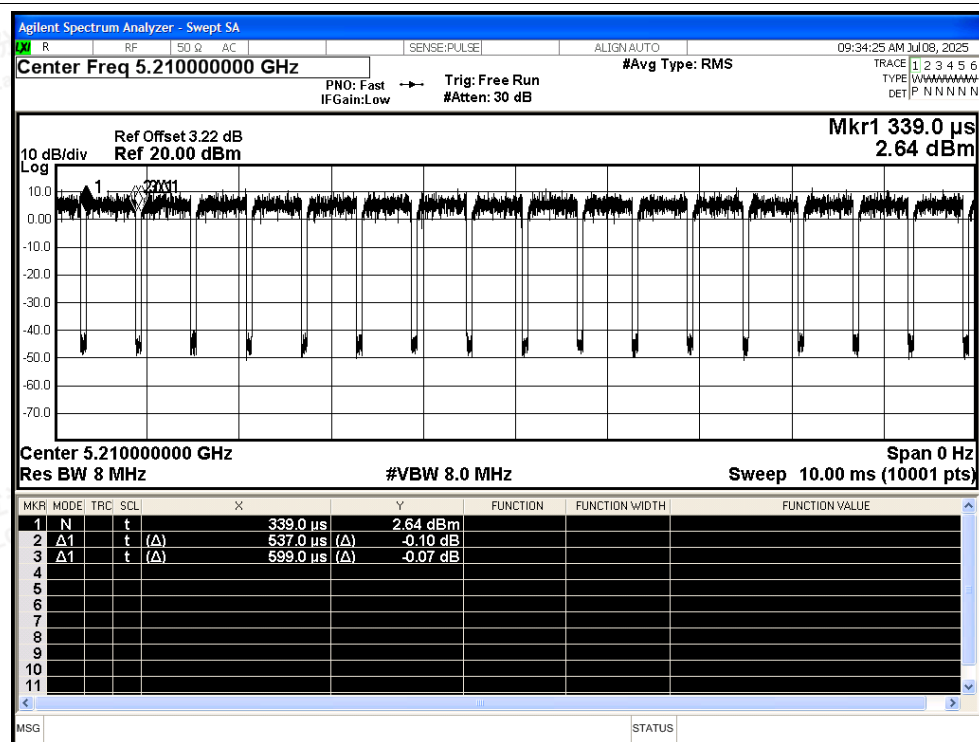

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5180MHz Ant1

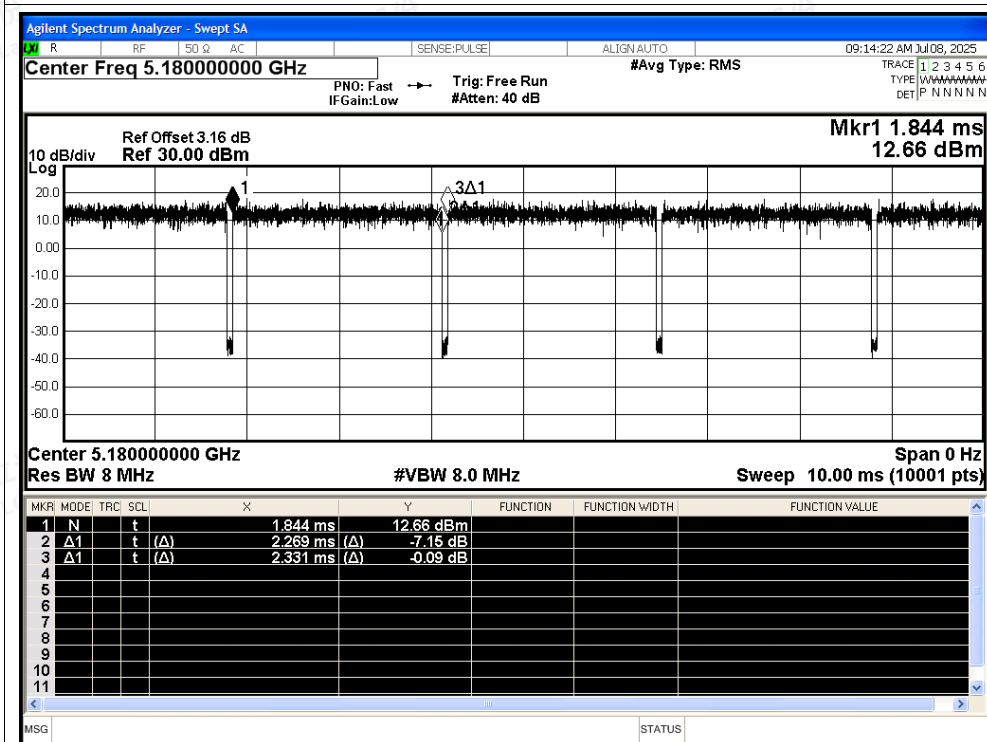

## Duty Cycle NVNT ax20 5200MHz Ant1

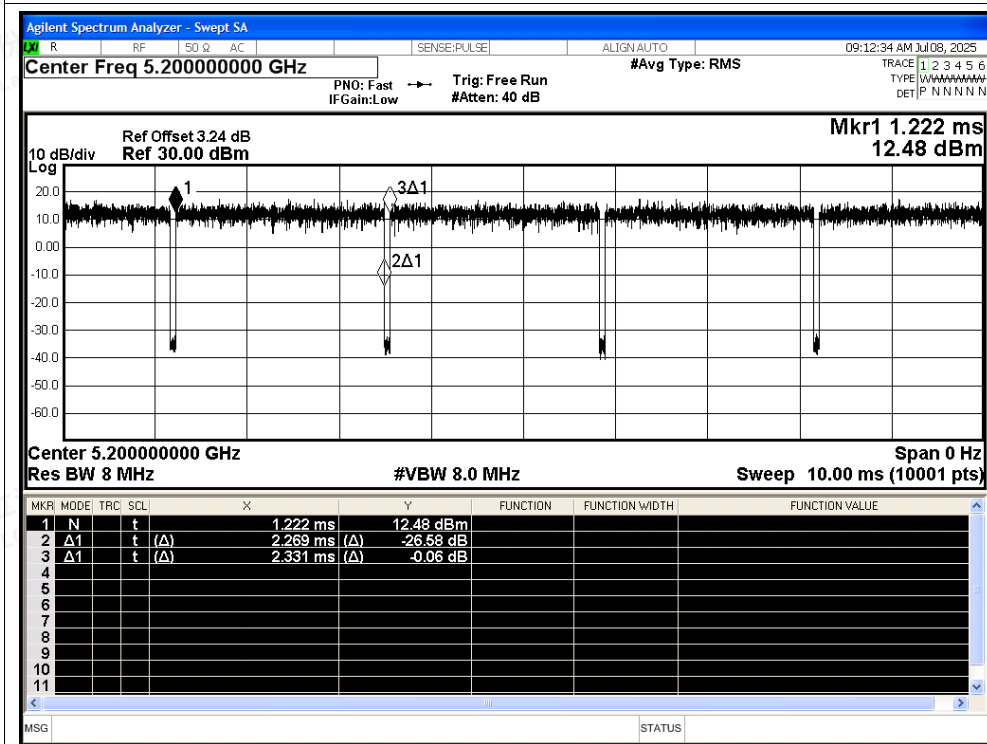

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5240MHz Ant1

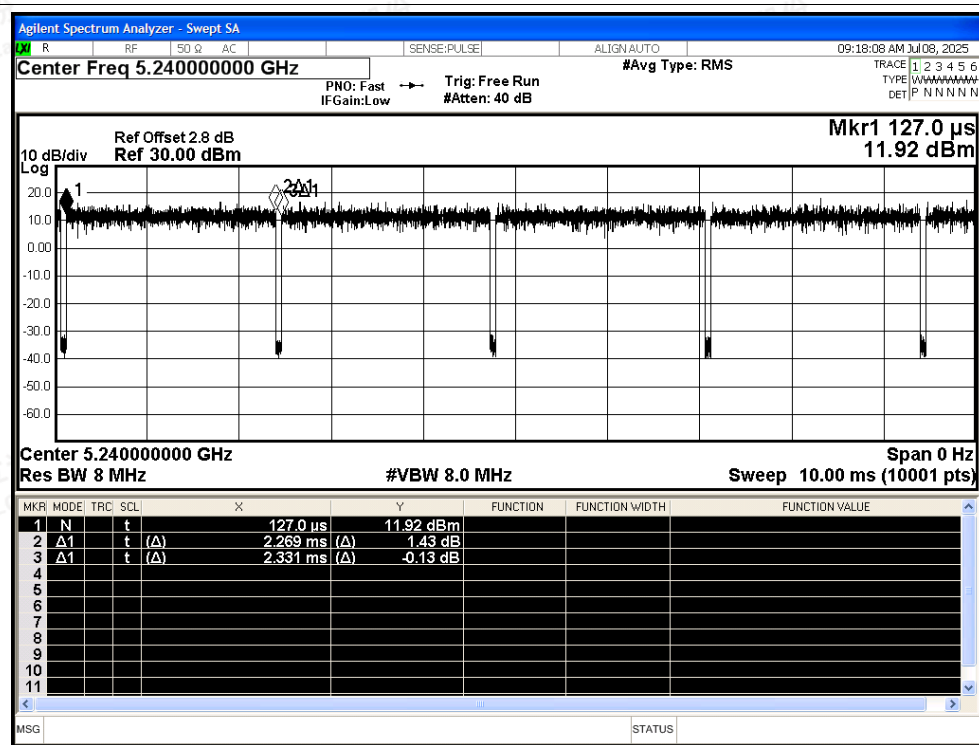

## Duty Cycle NVNT ax40 5190MHz Ant1

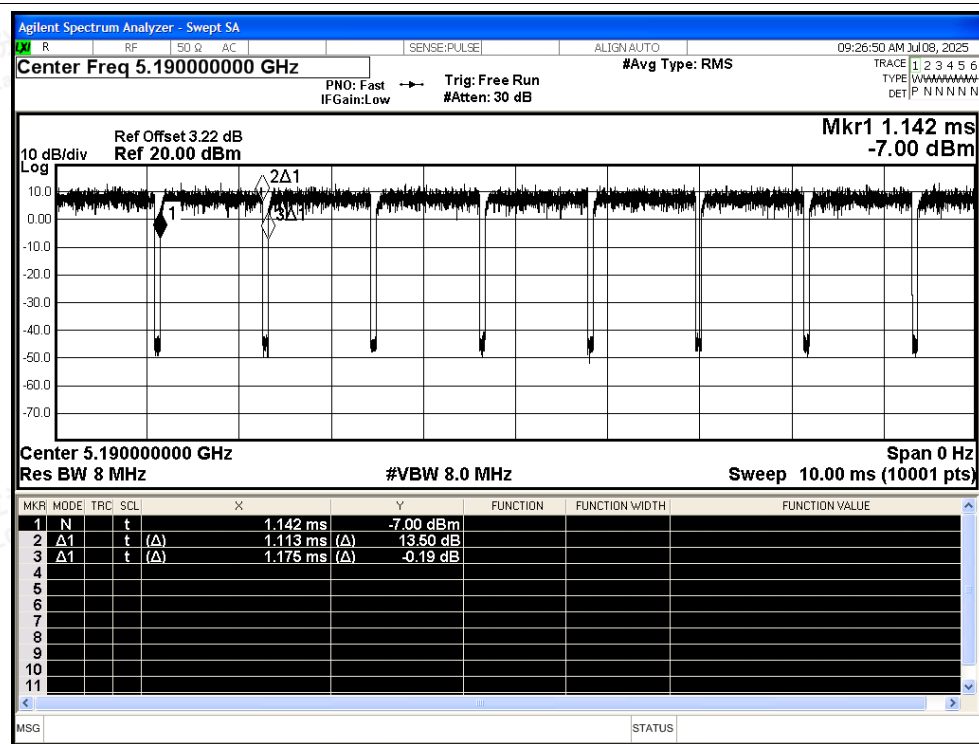

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5230MHz Ant1

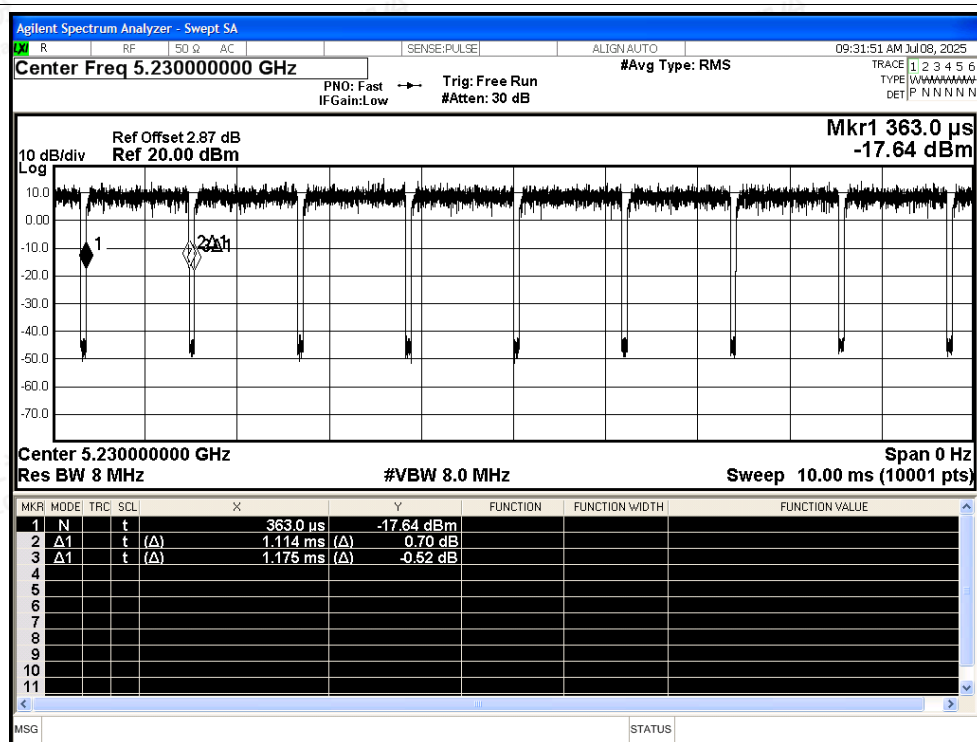

## Duty Cycle NVNT ax80 5210MHz Ant1

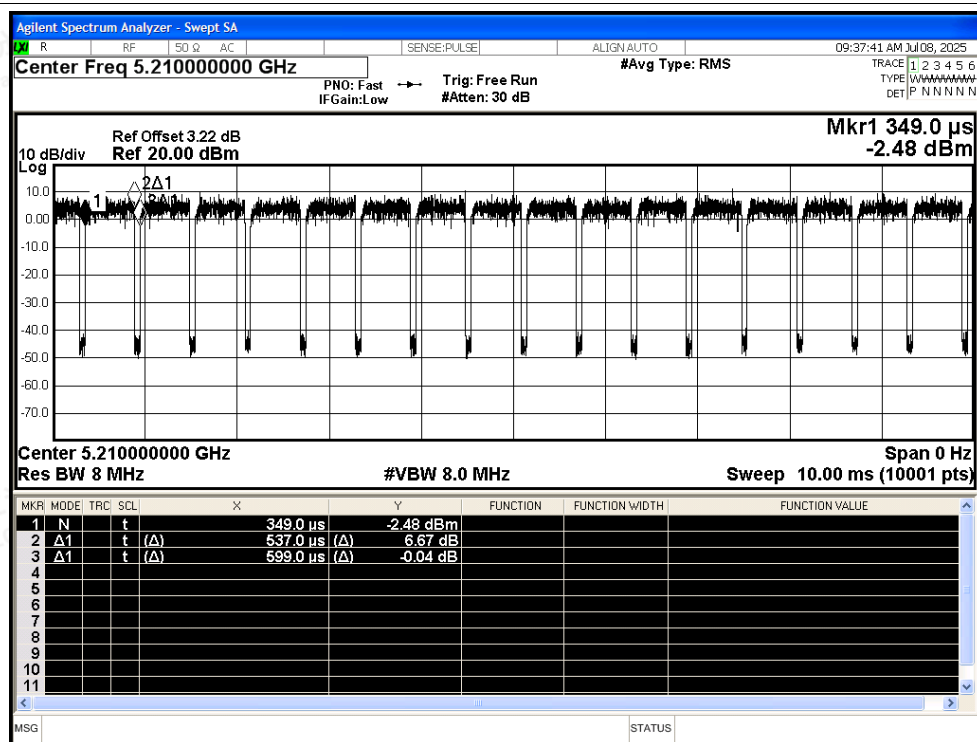

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5180            | Ant2    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5200            | Ant2    | 94.65          | 0.24                   | 0.91      |
| NVNT      | a    | 5240            | Ant2    | 94.56          | 0.24                   | 0.91      |
| NVNT      | n20  | 5180            | Ant2    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20  | 5200            | Ant2    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20  | 5240            | Ant2    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n40  | 5190            | Ant2    | 94.71          | 0.24                   | 0.9       |
| NVNT      | n40  | 5230            | Ant2    | 94.71          | 0.24                   | 0.9       |
| NVNT      | ac20 | 5180            | Ant2    | 97.3           | 0.12                   | 0.44      |
| NVNT      | ac20 | 5200            | Ant2    | 97.3           | 0.12                   | 0.44      |
| NVNT      | ac20 | 5240            | Ant2    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac40 | 5190            | Ant2    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ac40 | 5230            | Ant2    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ac80 | 5210            | Ant2    | 89.65          | 0.47                   | 1.86      |
| NVNT      | ax20 | 5180            | Ant2    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20 | 5200            | Ant2    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20 | 5240            | Ant2    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax40 | 5190            | Ant2    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ax40 | 5230            | Ant2    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ax80 | 5210            | Ant2    | 89.65          | 0.47                   | 1.86      |






## Test Graphs

## Duty Cycle NVNT a 5180MHz Ant2

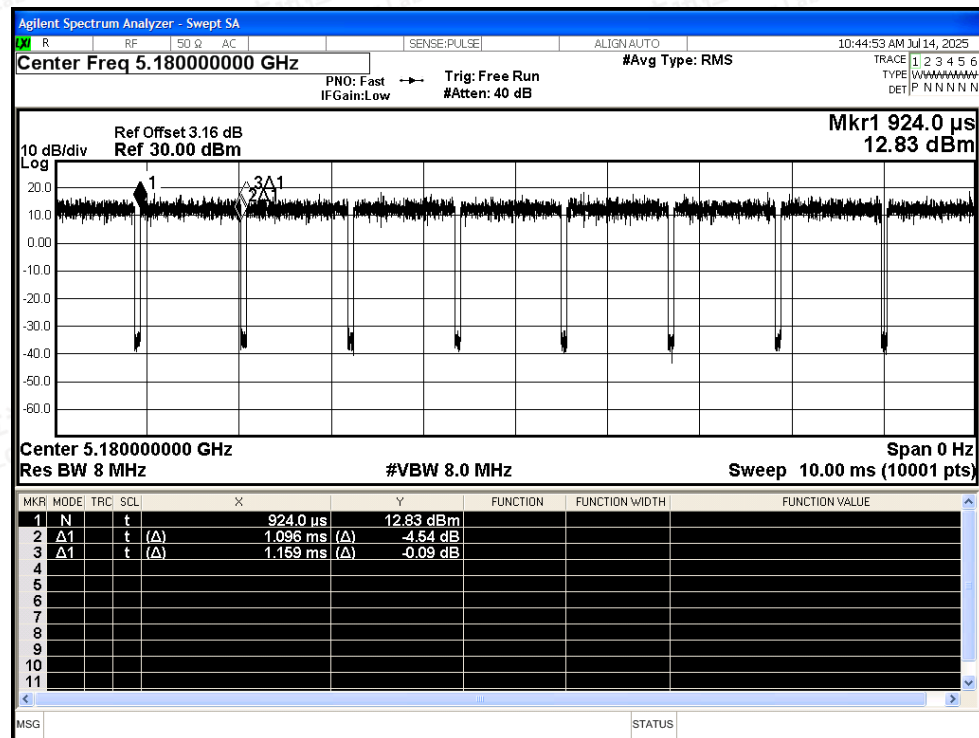

## Duty Cycle NVNT a 5200MHz Ant2

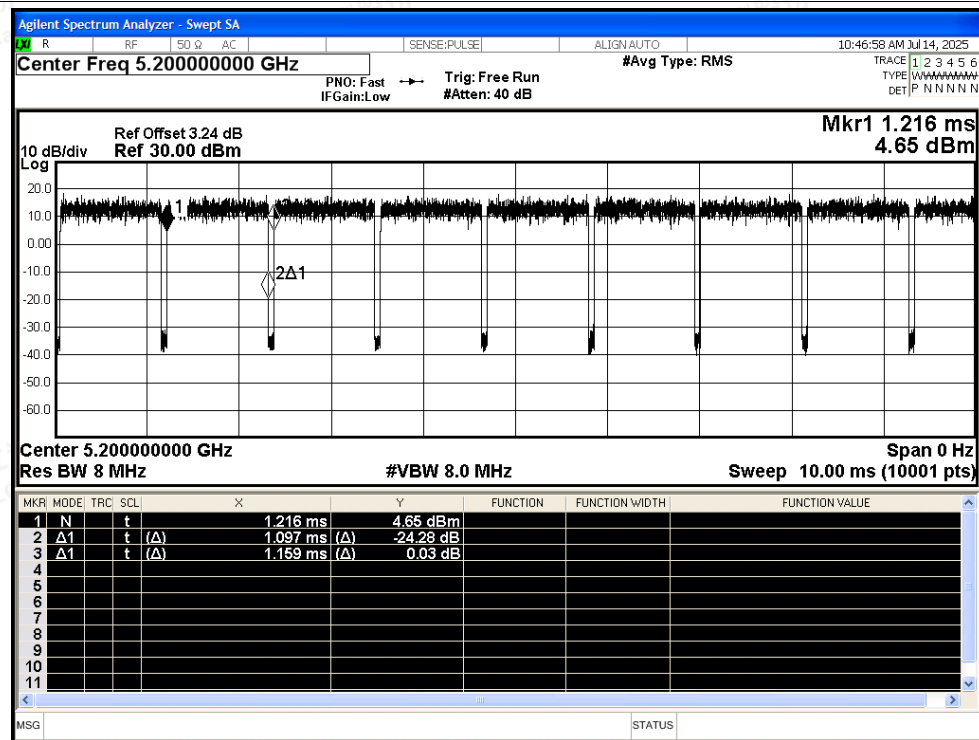

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5240MHz Ant2

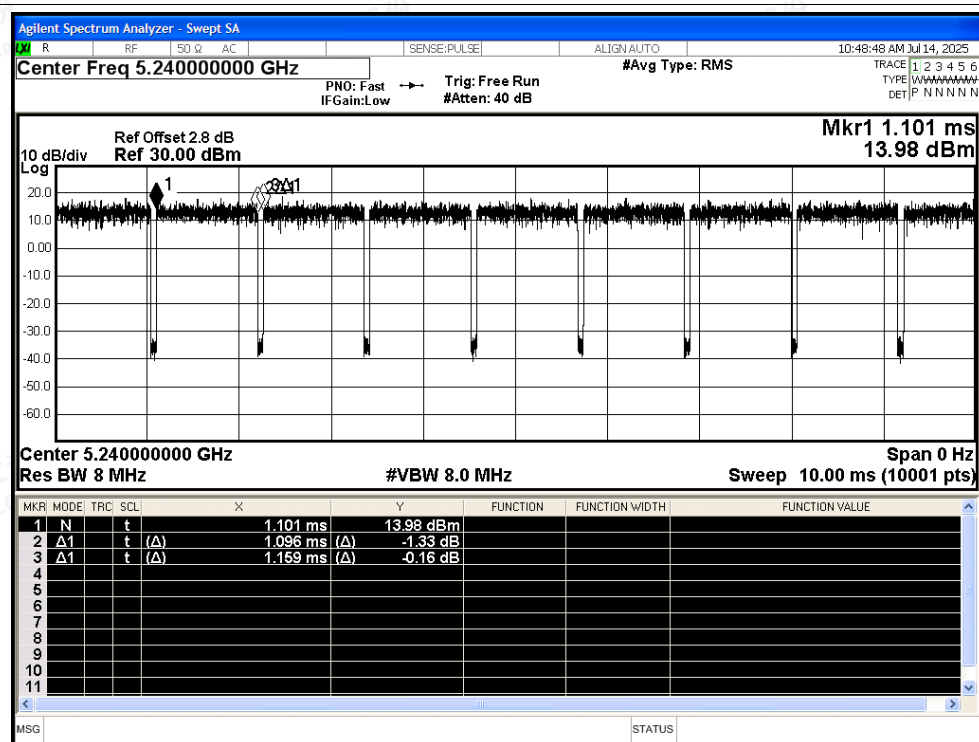

## Duty Cycle NVNT n20 5180MHz Ant2


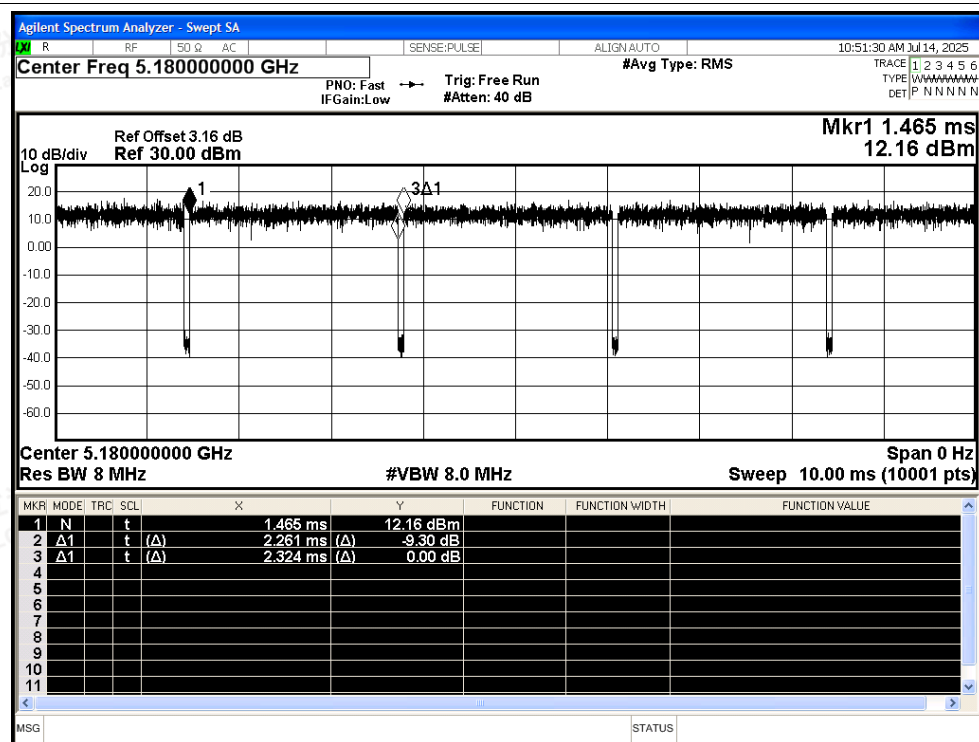


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

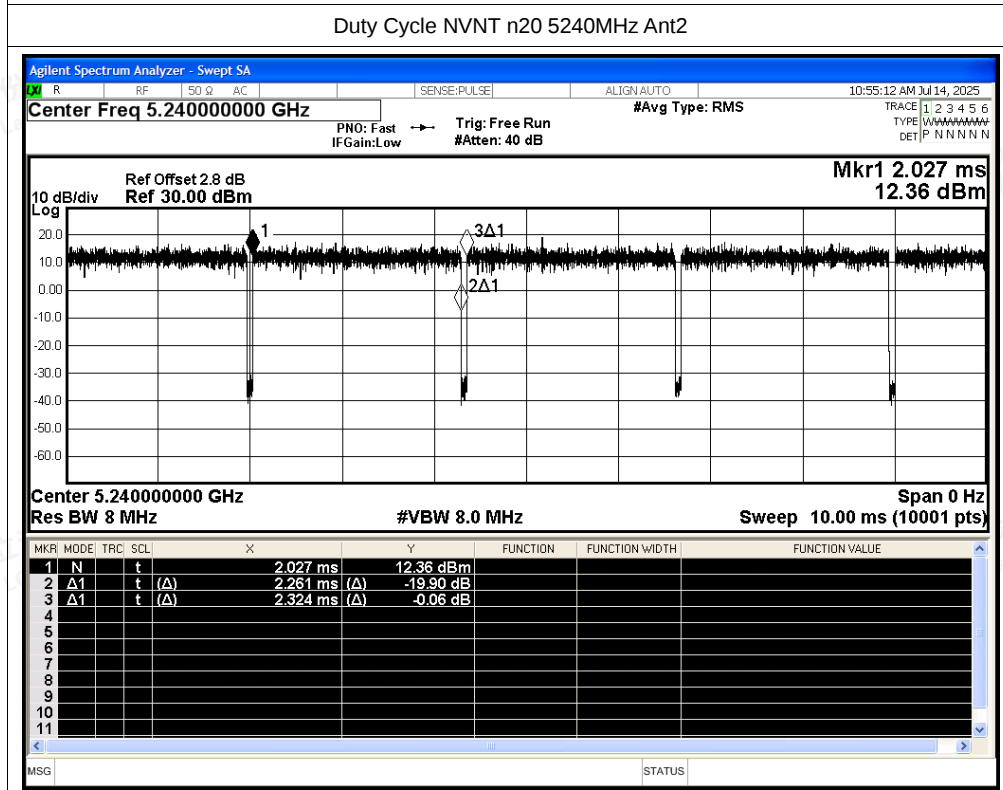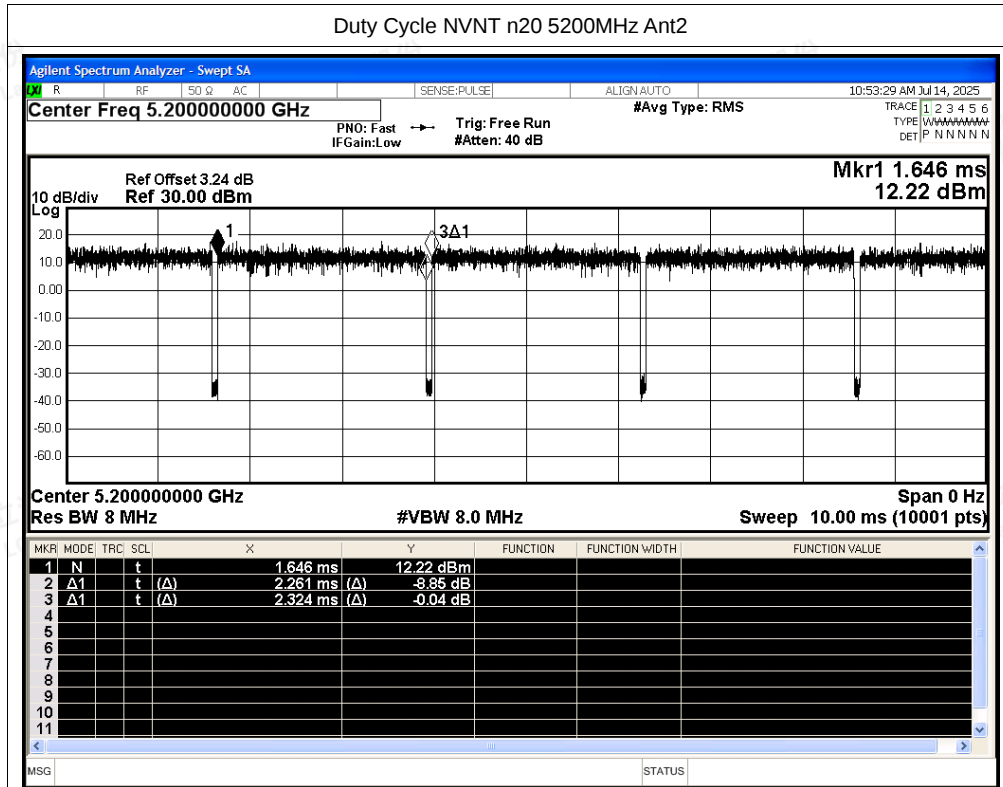

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5190MHz Ant2

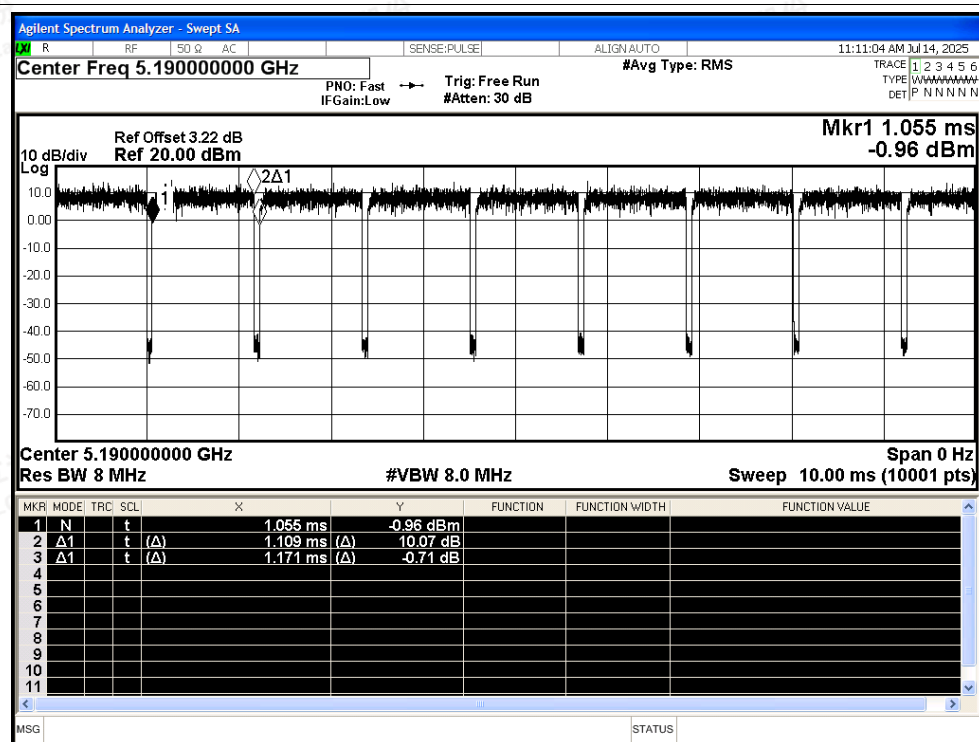

## Duty Cycle NVNT n40 5230MHz Ant2

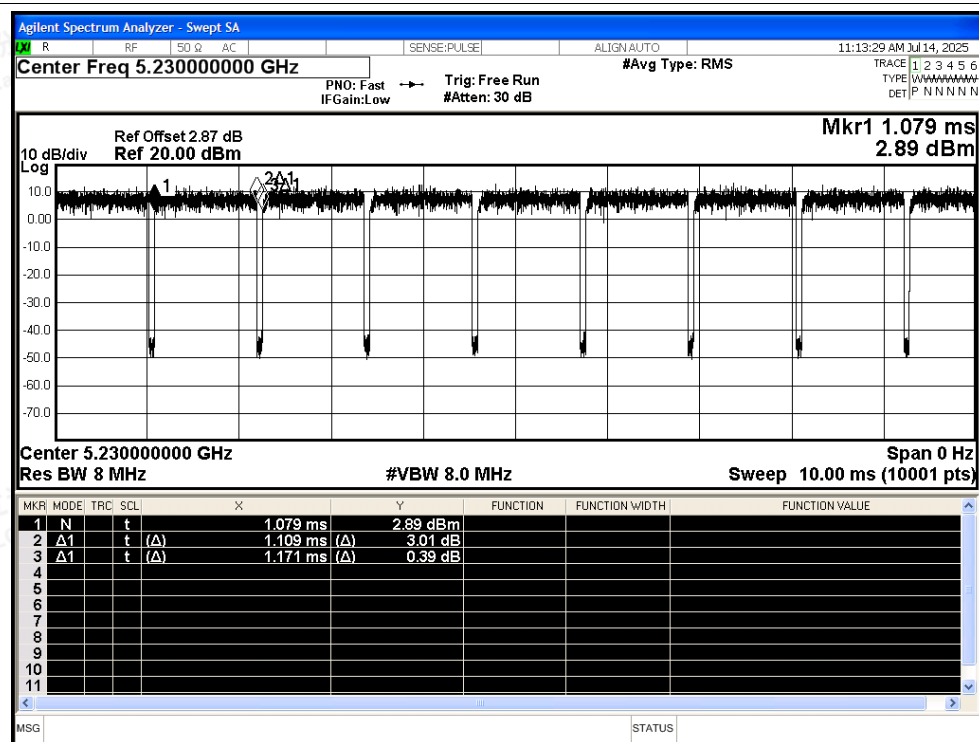

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5180MHz Ant2

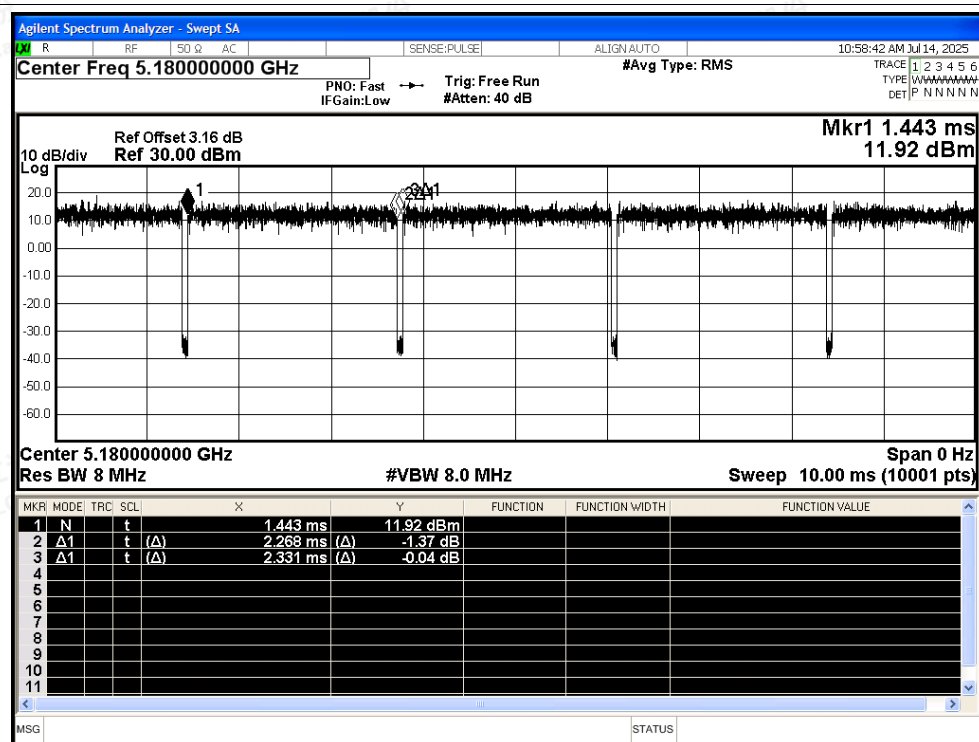

## Duty Cycle NVNT ac20 5200MHz Ant2

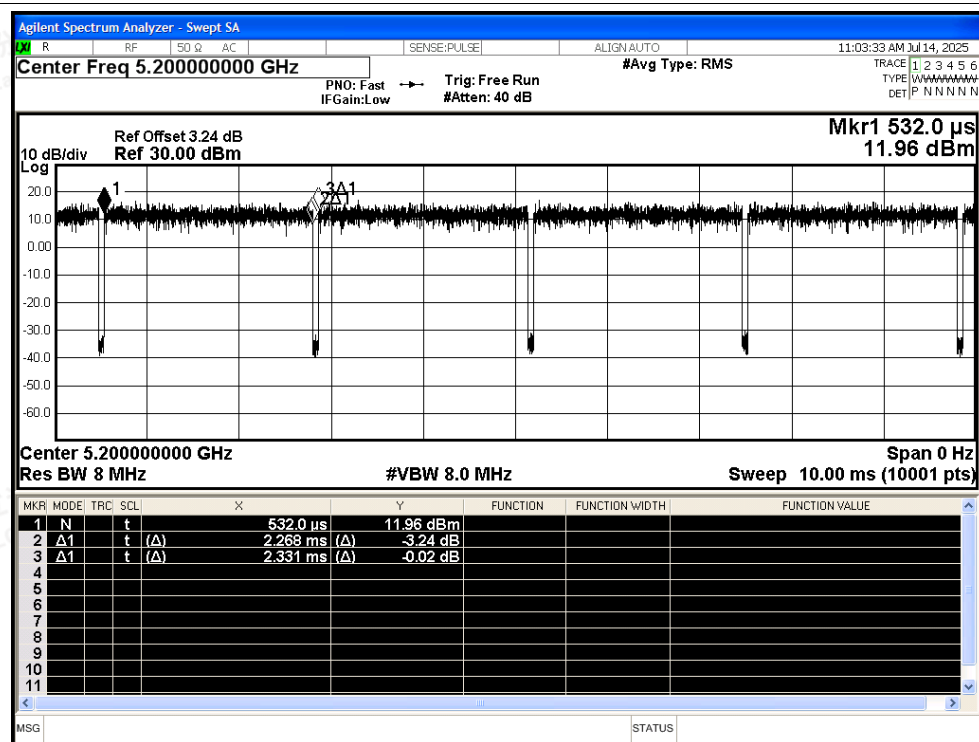

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5240MHz Ant2

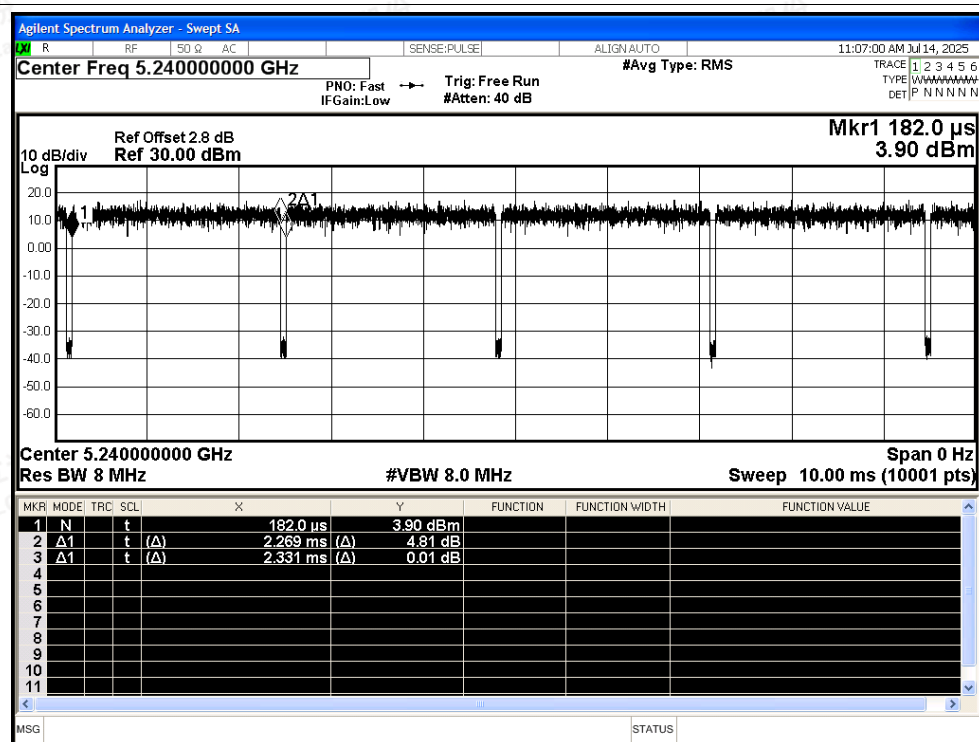

## Duty Cycle NVNT ac40 5190MHz Ant2

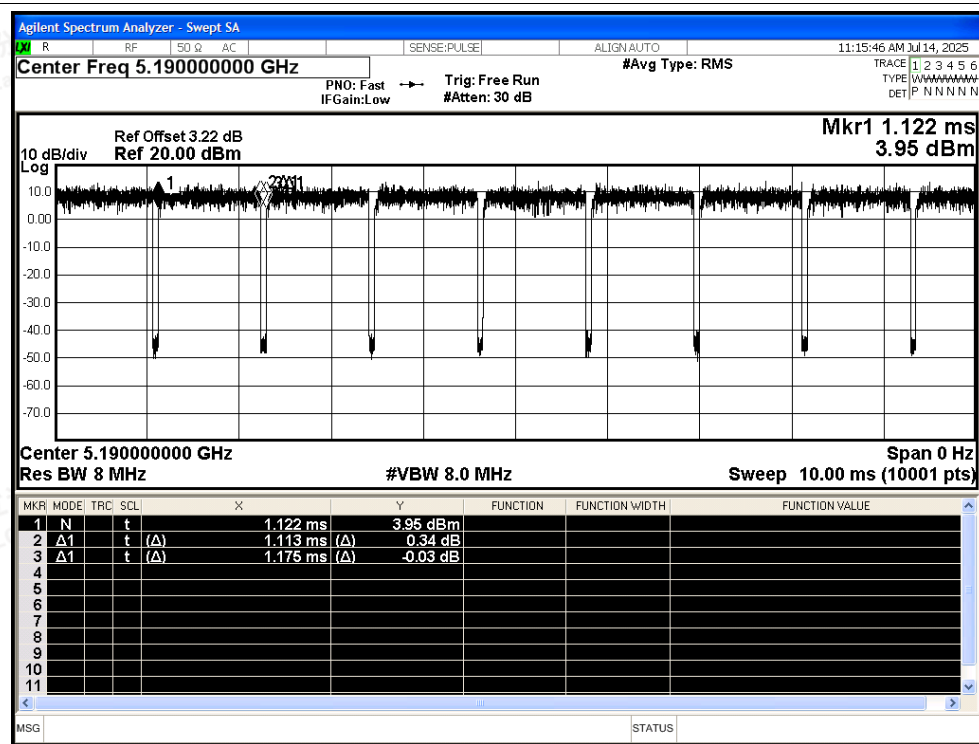

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5230MHz Ant2

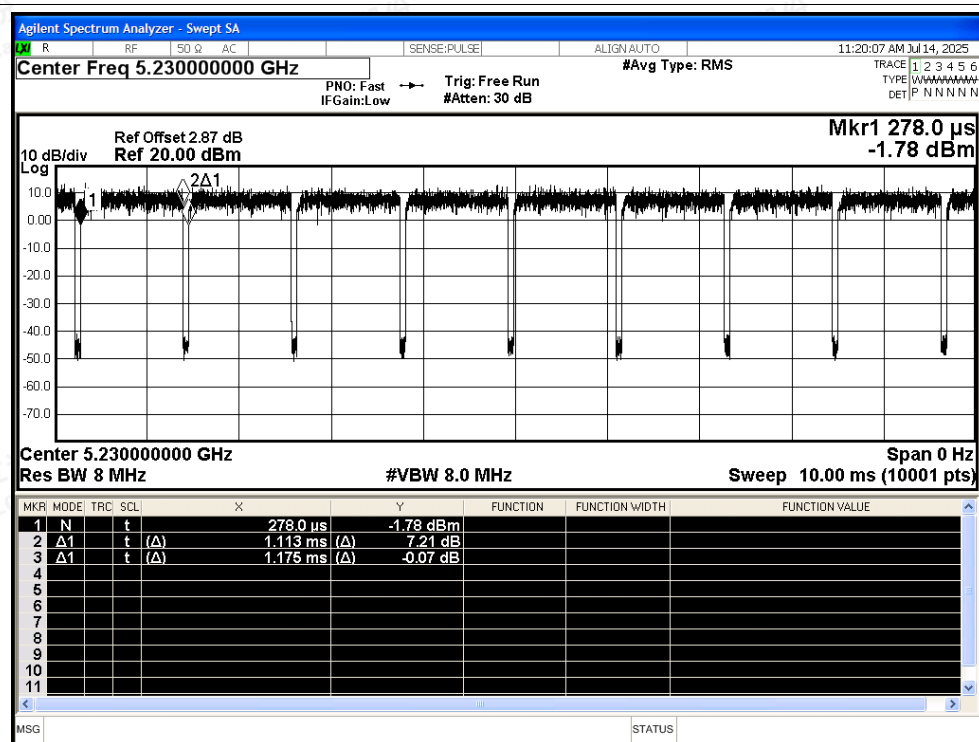

## Duty Cycle NVNT ac80 5210MHz Ant2

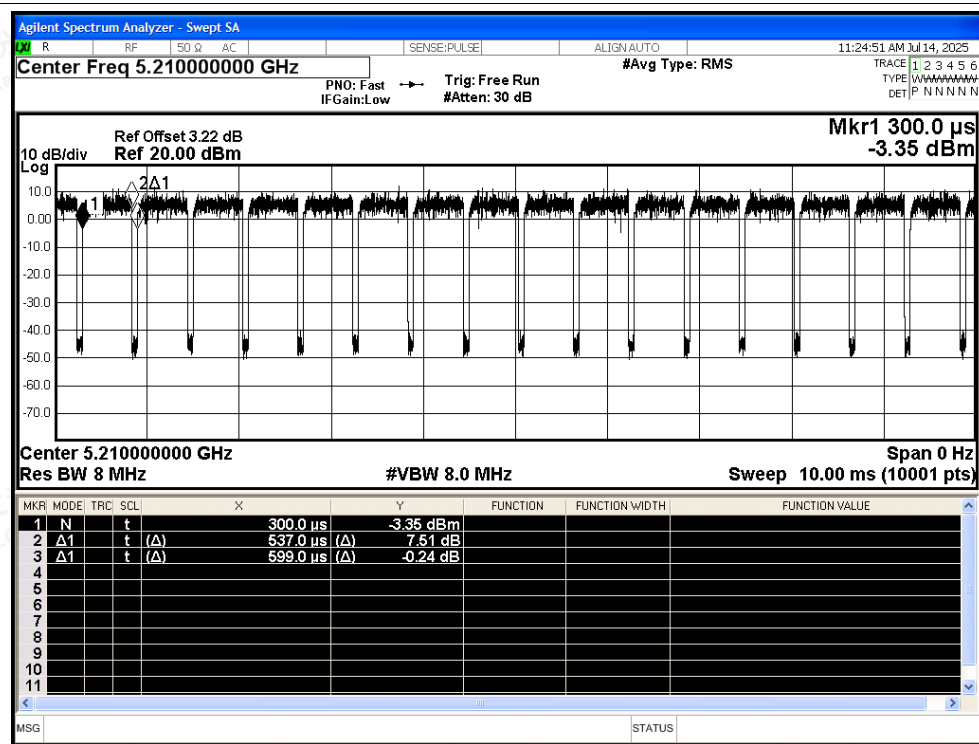

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5180MHz Ant2

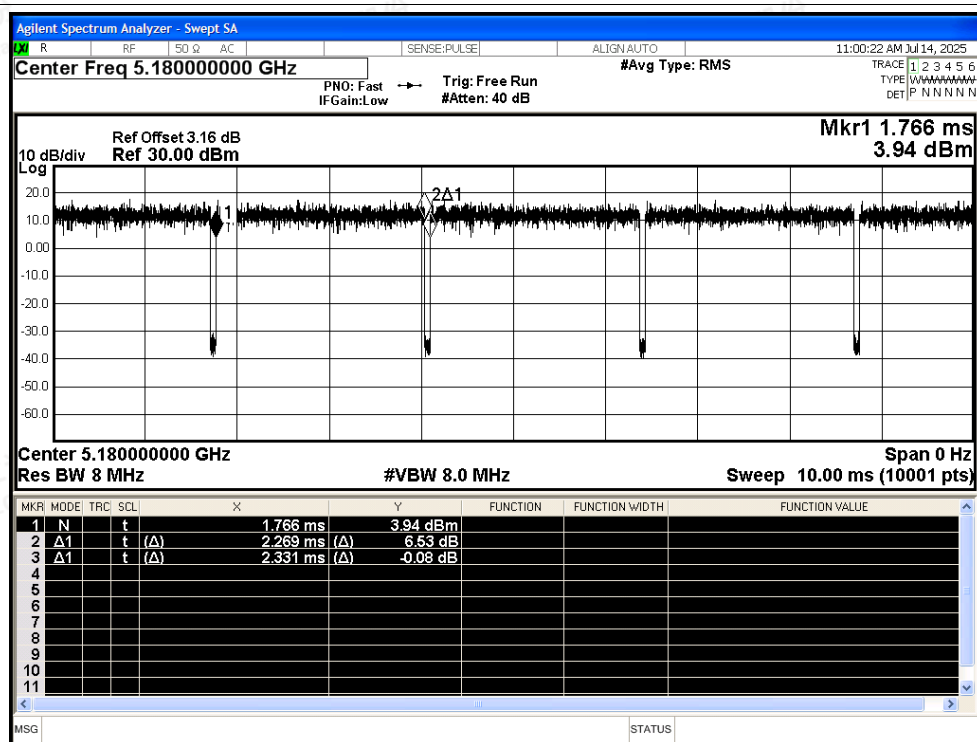

## Duty Cycle NVNT ax20 5200MHz Ant2

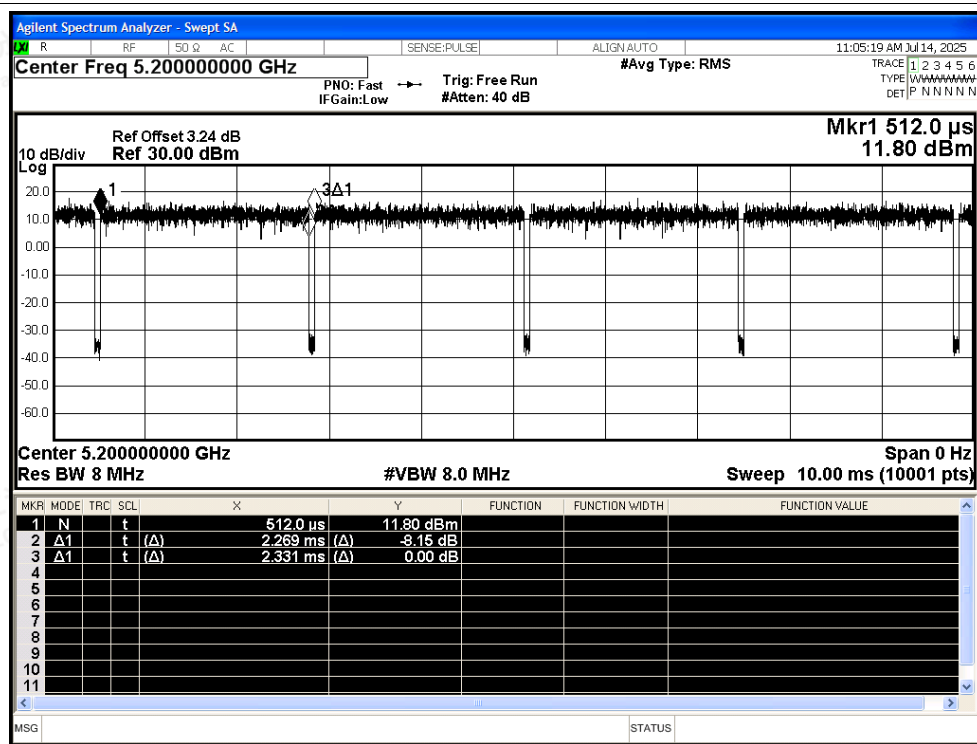

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5240MHz Ant2

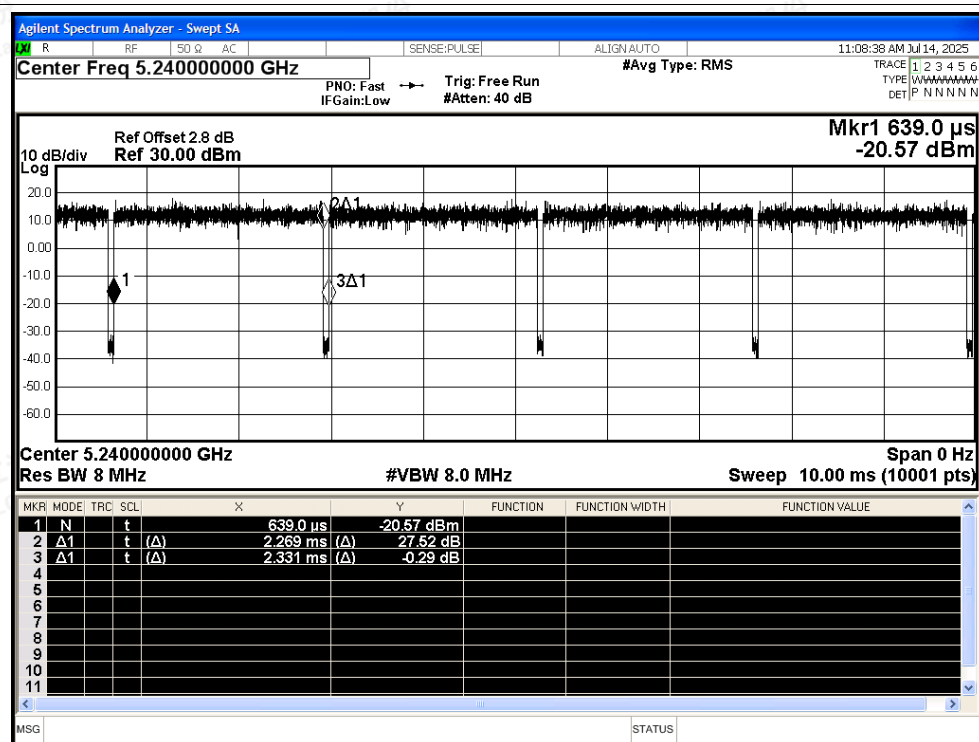

## Duty Cycle NVNT ax40 5190MHz Ant2

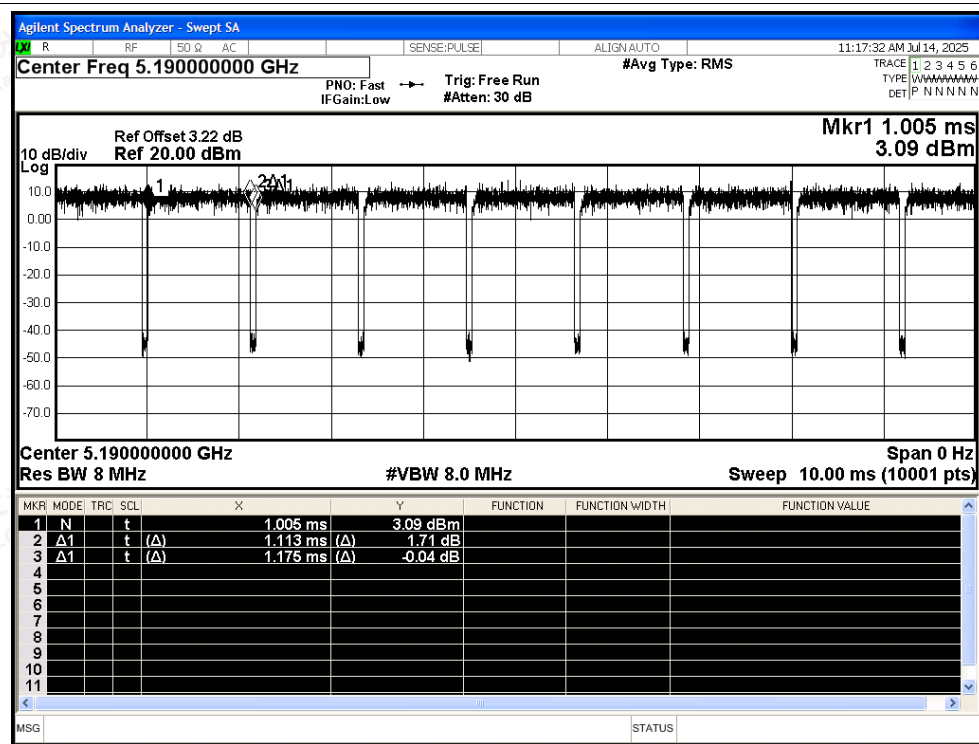

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5230MHz Ant2

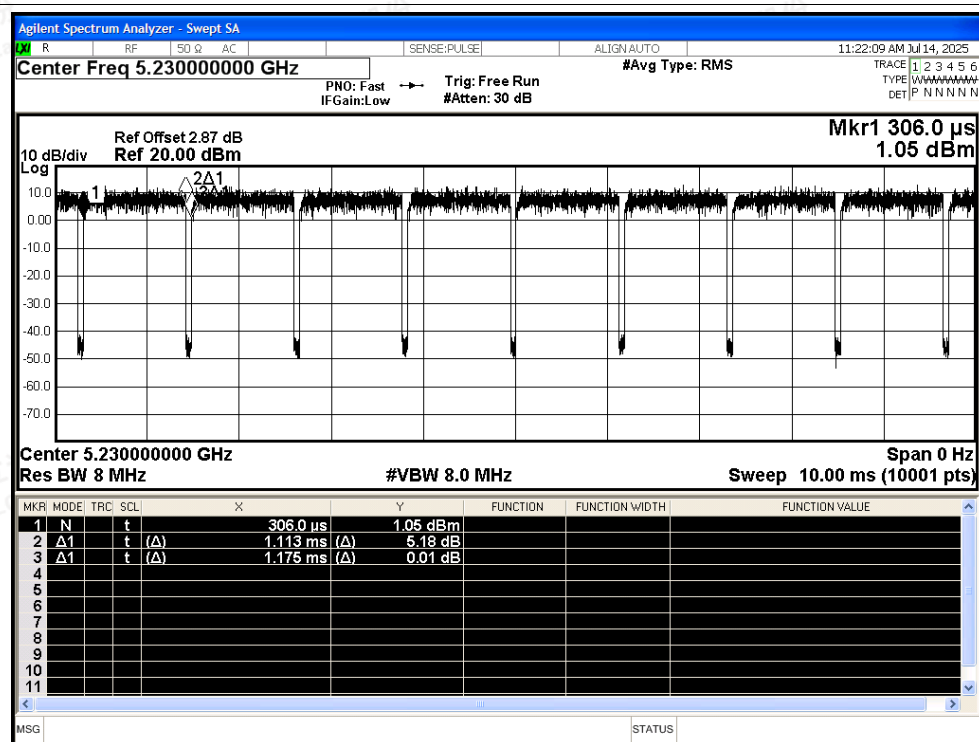

## Duty Cycle NVNT ax80 5210MHz Ant2

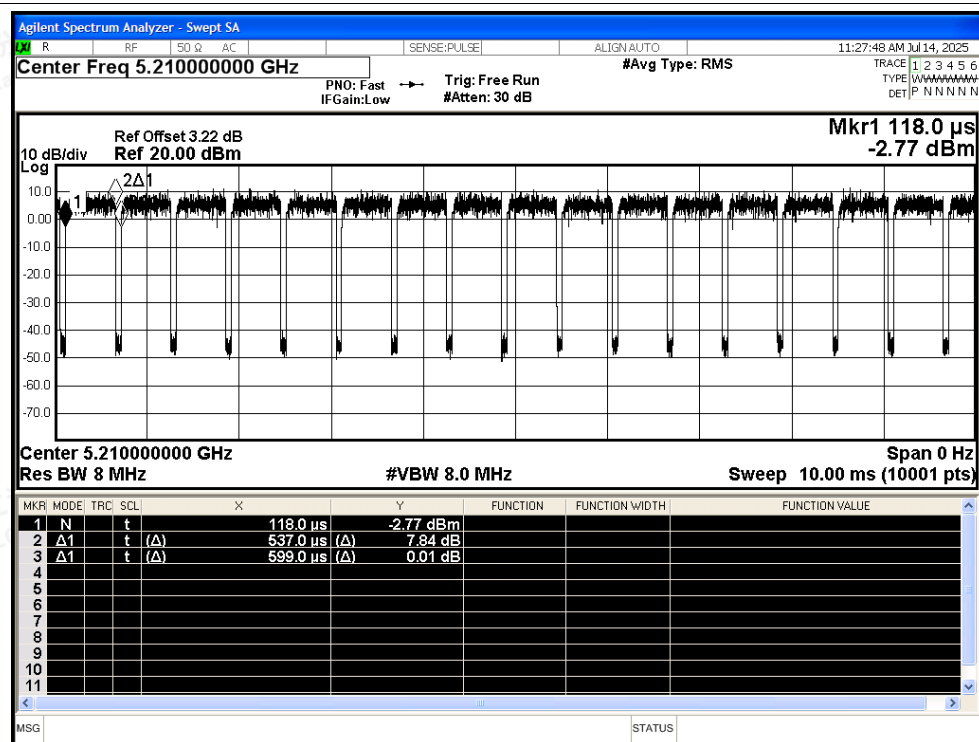

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity