



NVNT	ac20	5260	Ant4	4500	-58.41	5.19	0.12	42.13	Average	54	Pass
NVNT	ac20	5260	Ant4	4915.74	-46.42	5.19	-	54.00	Peak	68.2	Pass
NVNT	ac20	5260	Ant4	5127.9	-56.81	5.19	0.12	43.73	Average	54	Pass
NVNT	ac20	5260	Ant4	5150	-49.07	5.19	-	51.35	Peak	68.2	Pass
NVNT	ac20	5260	Ant4	5150	-57	5.19	0.12	43.54	Average	54	Pass
NVNT	ac20	5320	Ant4	5350	-44.87	5.19	-	55.55	Peak	68.2	Pass
NVNT	ac20	5320	Ant4	5350	-55.87	5.19	0.12	44.67	Average	54	Pass
NVNT	ac20	5320	Ant4	5350.4	-42.61	5.19	-	57.81	Peak	68.2	Pass
NVNT	ac20	5320	Ant4	5351.2	-54.96	5.19	0.12	45.58	Average	54	Pass
NVNT	ac20	5320	Ant4	5460	-49.67	5.19	-	50.75	Peak	68.2	Pass
NVNT	ac20	5320	Ant4	5460	-57.65	5.19	0.12	42.89	Average	54	Pass
NVNT	ac40	5270	Ant4	4500	-50.47	5.19	-	49.95	Peak	68.2	Pass
NVNT	ac40	5270	Ant4	4500	-59.31	5.19	0.12	41.23	Average	54	Pass
NVNT	ac40	5270	Ant4	5076.72	-46.36	5.19	-	54.06	Peak	68.2	Pass
NVNT	ac40	5270	Ant4	4807.8	-56.83	5.19	0.12	43.71	Average	54	Pass
NVNT	ac40	5270	Ant4	5150	-49.69	5.19	-	50.73	Peak	68.2	Pass
NVNT	ac40	5270	Ant4	5150	-57.29	5.19	0.12	43.25	Average	54	Pass
NVNT	ac40	5310	Ant4	5350	-44.44	5.19	-	55.98	Peak	68.2	Pass
NVNT	ac40	5310	Ant4	5350	-55.98	5.19	0.12	44.56	Average	54	Pass
NVNT	ac40	5310	Ant4	5350.2	-42.47	5.19	-	57.95	Peak	68.2	Pass
NVNT	ac40	5310	Ant4	5350.8	-55.71	5.19	0.12	44.83	Average	54	Pass
NVNT	ac40	5310	Ant4	5460	-49.69	5.19	-	50.73	Peak	68.2	Pass
NVNT	ac40	5310	Ant4	5460	-58.4	5.19	0.12	42.14	Average	54	Pass
NVNT	ac80	5290	Ant4	4500	-51	5.19	-	49.42	Peak	68.2	Pass
NVNT	ac80	5290	Ant4	4500	-59.72	5.19	0.25	40.95	Average	54	Pass
NVNT	ac80	5290	Ant4	4961.97	-46.21	5.19	-	54.21	Peak	68.2	Pass
NVNT	ac80	5290	Ant4	5124.66	-56.56	5.19	0.25	44.11	Average	54	Pass
NVNT	ac80	5290	Ant4	5150	-48.62	5.19	-	51.80	Peak	68.2	Pass
NVNT	ac80	5290	Ant4	5150	-56.8	5.19	0.25	43.87	Average	54	Pass
NVNT	ac80	5290	Ant4	5350	-43.94	5.19	-	56.48	Peak	68.2	Pass
NVNT	ac80	5290	Ant4	5350	-55.24	5.19	0.25	45.43	Average	54	Pass
NVNT	ac80	5290	Ant4	5351.5	-43.82	5.19	-	56.60	Peak	68.2	Pass
NVNT	ac80	5290	Ant4	5350	-55.24	5.19	0.25	45.43	Average	54	Pass
NVNT	ac80	5290	Ant4	5460	-50.05	5.19	-	50.37	Peak	68.2	Pass
NVNT	ac80	5290	Ant4	5460	-57.56	5.19	0.25	43.11	Average	54	Pass
NVNT	ax20	5260	Ant4	4500	-50.55	5.19	-	49.87	Peak	68.2	Pass
NVNT	ax20	5260	Ant4	4500	-59.8	5.19	0.12	40.74	Average	54	Pass
NVNT	ax20	5260	Ant4	5092.02	-47.01	5.19	-	53.41	Peak	68.2	Pass
NVNT	ax20	5260	Ant4	5074.08	-57	5.19	0.12	43.54	Average	54	Pass
NVNT	ax20	5260	Ant4	5150	-48.75	5.19	-	51.67	Peak	68.2	Pass
NVNT	ax20	5260	Ant4	5150	-57.35	5.19	0.12	43.19	Average	54	Pass





NVNT	ax20	5320	Ant4	5350	-45.66	5.19	-	54.76	Peak	68.2	Pass
NVNT	ax20	5320	Ant4	5350	-55.28	5.19	0.12	45.26	Average	54	Pass
NVNT	ax20	5320	Ant4	5350.6	-42.61	5.19	-	57.81	Peak	68.2	Pass
NVNT	ax20	5320	Ant4	5350	-55.28	5.19	0.12	45.26	Average	54	Pass
NVNT	ax20	5320	Ant4	5460	-50.83	5.19	-	49.59	Peak	68.2	Pass
NVNT	ax20	5320	Ant4	5460	-57.99	5.19	0.12	42.55	Average	54	Pass
NVNT	ax40	5270	Ant4	4500	-50.45	5.19	-	49.97	Peak	68.2	Pass
NVNT	ax40	5270	Ant4	4500	-58.71	5.19	0.12	41.83	Average	54	Pass
NVNT	ax40	5270	Ant4	5079.96	-46.09	5.19	-	54.33	Peak	68.2	Pass
NVNT	ax40	5270	Ant4	5062.95	-56.78	5.19	0.12	43.76	Average	54	Pass
NVNT	ax40	5270	Ant4	5150	-48.3	5.19	-	52.12	Peak	68.2	Pass
NVNT	ax40	5270	Ant4	5150	-57.81	5.19	0.12	42.73	Average	54	Pass
NVNT	ax40	5310	Ant4	5350	-43.09	5.19	-	57.33	Peak	68.2	Pass
NVNT	ax40	5310	Ant4	5350	-55.57	5.19	0.12	44.97	Average	54	Pass
NVNT	ax40	5310	Ant4	5460	-50.4	5.19	-	50.02	Peak	68.2	Pass
NVNT	ax40	5310	Ant4	5460	-57.65	5.19	0.12	42.89	Average	54	Pass
NVNT	ax80	5290	Ant4	5350	-47.43	5.19	-	52.99	Peak	68.2	Pass
NVNT	ax80	5290	Ant4	5350	-54.82	5.19	0.25	45.85	Average	54	Pass
NVNT	ax80	5290	Ant4	5353.5	-44.58	5.19	-	55.84	Peak	68.2	Pass
NVNT	ax80	5290	Ant4	5350	-54.82	5.19	0.25	45.85	Average	54	Pass
NVNT	ax80	5290	Ant4	5460	-50.68	5.19	-	49.74	Peak	68.2	Pass
NVNT	ax80	5290	Ant4	5460	-58.21	5.19	0.25	42.46	Average	54	Pass
NVNT	ax80	5290	Ant4	4500	-51.37	5.19	-	49.05	Peak	68.2	Pass
NVNT	ax80	5290	Ant4	4500	-58.87	5.19	0.25	41.80	Average	54	Pass
NVNT	ax80	5290	Ant4	5145.54	-45.9	5.19	-	54.52	Peak	68.2	Pass
NVNT	ax80	5290	Ant4	5138.58	-56.38	5.19	0.25	44.29	Average	54	Pass
NVNT	ax80	5290	Ant4	5150	-47.79	5.19	-	52.63	Peak	68.2	Pass
NVNT	ax80	5290	Ant4	5150	-56.97	5.19	0.25	43.70	Average	54	Pass
NVNT	ac160	5250	Ant4	5350	-49.21	5.19	-	51.21	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	5350	-57.35	5.19	0.24	43.31	Average	54	Pass
NVNT	ac160	5250	Ant4	5354.55	-47.15	5.19	-	53.27	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	5354.55	-55.08	5.19	0.24	45.58	Average	54	Pass
NVNT	ac160	5250	Ant4	5460	-55.44	5.19	-	44.98	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	5460	-65.5	5.19	0.24	35.16	Average	54	Pass
NVNT	ac160	5250	Ant4	4500	-60.65	5.19	-	39.77	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	4500	-67.75	5.19	0.24	32.91	Average	54	Pass
NVNT	ac160	5250	Ant4	5147.01	-48.76	5.19	-	51.66	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	5144.28	-56.55	5.19	0.24	44.11	Average	54	Pass
NVNT	ac160	5250	Ant4	5150	-52.21	5.19	-	48.21	Peak	68.2	Pass
NVNT	ac160	5250	Ant4	5150	-60.27	5.19	0.24	40.39	Average	54	Pass
NVNT	ax160	5250	Ant4	5350	-47.32	5.19	-	53.10	Peak	68.2	Pass





NVNT	ax160	5250	Ant4	5350	-55.81	5.19	0.63	45.24	Average	54	Pass
NVNT	ax160	5250	Ant4	5372.68	-44	5.19	-	56.42	Peak	68.2	Pass
NVNT	ax160	5250	Ant4	5353.07	-55.8	5.19	0.63	45.25	Average	54	Pass
NVNT	ax160	5250	Ant4	5460	-56.69	5.19	-	43.73	Peak	68.2	Pass
NVNT	ax160	5250	Ant4	5460	-65.58	5.19	0.63	35.47	Average	54	Pass
NVNT	ax160	5250	Ant4	4500	-59.83	5.19	-	40.59	Peak	68.2	Pass
NVNT	ax160	5250	Ant4	4500	-67.82	5.19	0.63	33.23	Average	54	Pass
NVNT	ax160	5250	Ant4	5134.27	-43.08	5.19	-	57.34	Peak	68.2	Pass
NVNT	ax160	5250	Ant4	5122.44	-55.8	5.19	0.63	45.25	Average	54	Pass
NVNT	ax160	5250	Ant4	5150	-46.36	5.19	-	54.06	Peak	68.2	Pass
NVNT	ax160	5250	Ant4	5150	-57.02	5.19	0.63	44.03	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant4 Peak

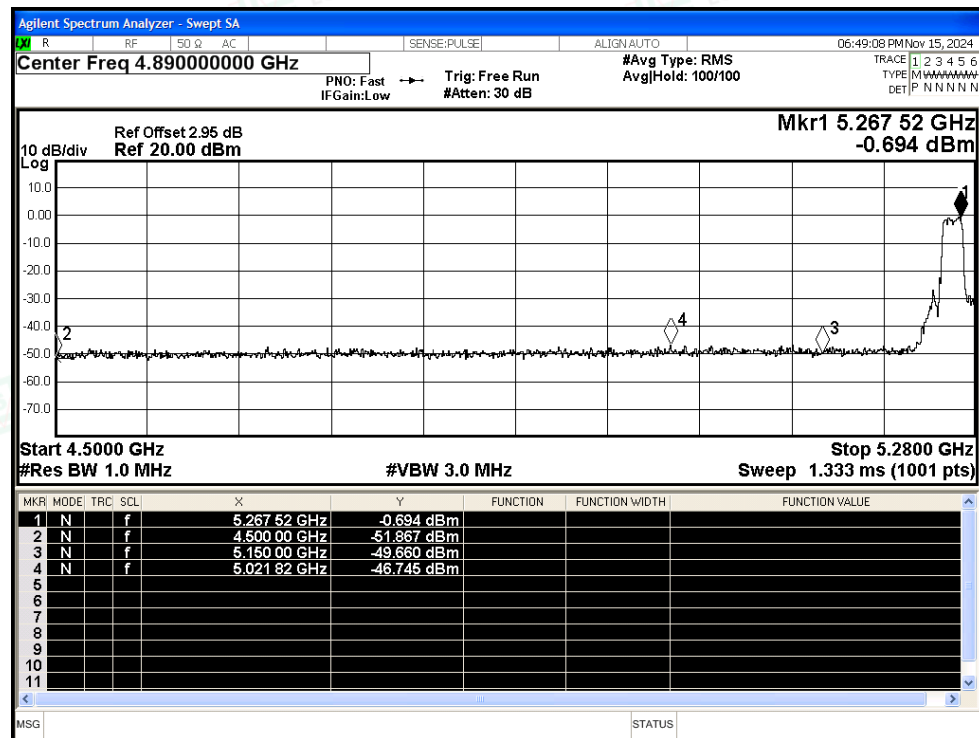

Restrict Band NVNT a 5260MHz Ant4 Average

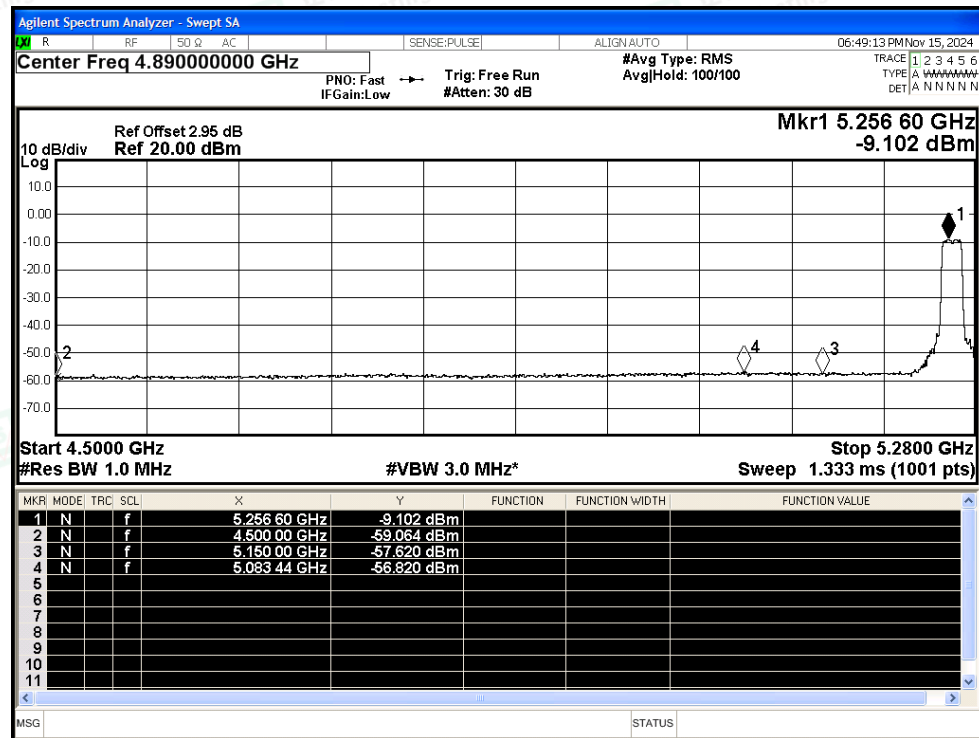

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant4 Peak

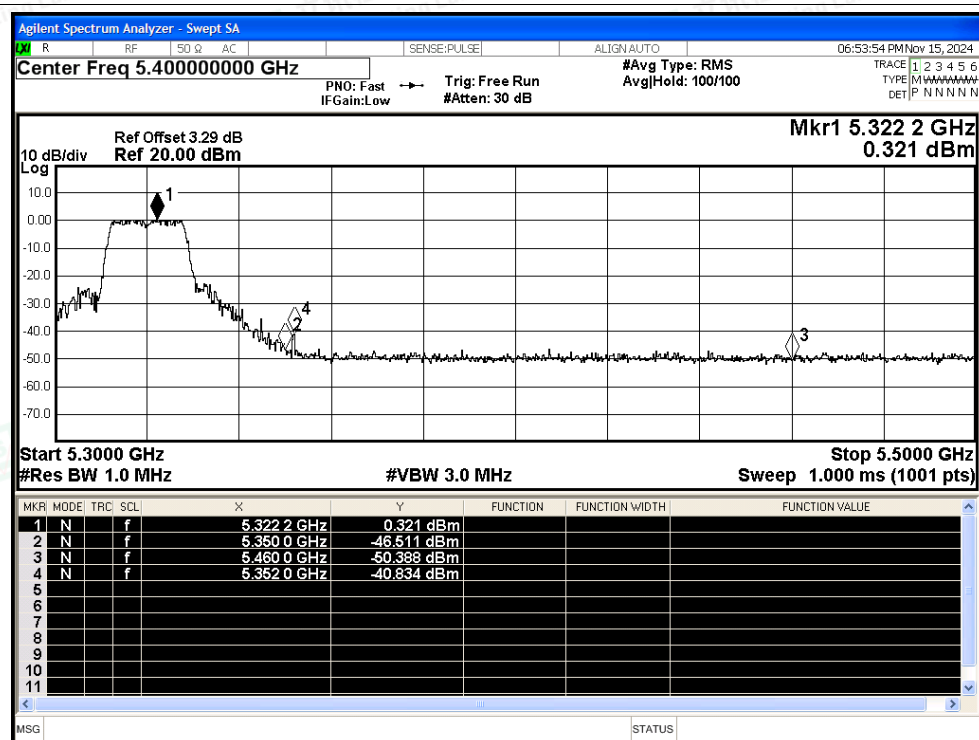

Restrict Band NVNT a 5320MHz Ant4 Average

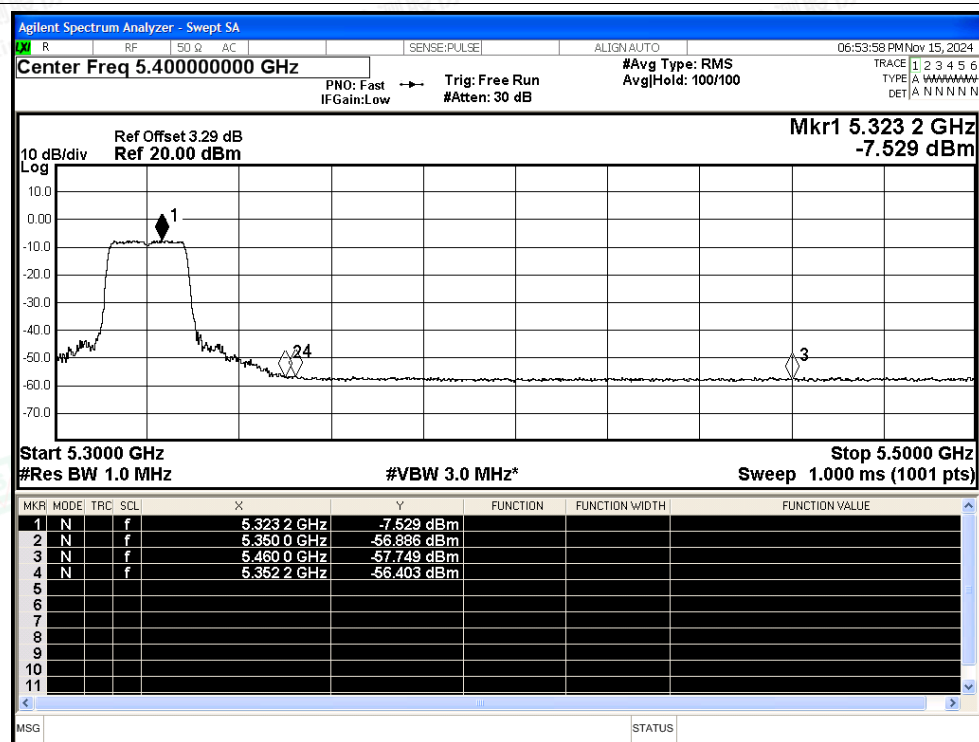

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant4 Peak

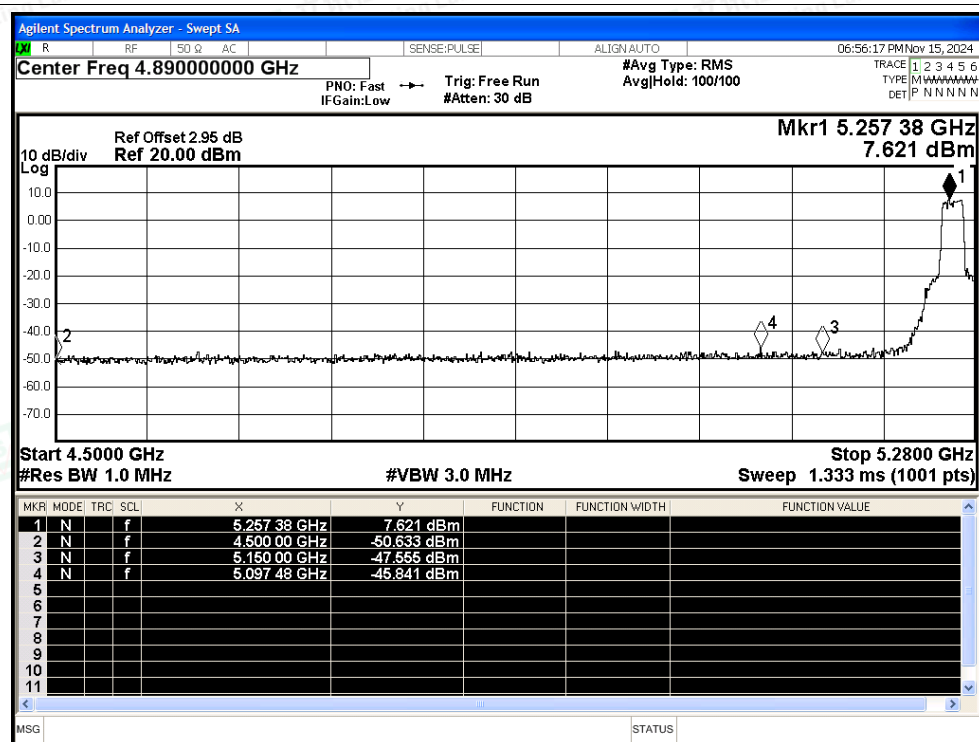

Restrict Band NVNT n20 5260MHz Ant4 Average

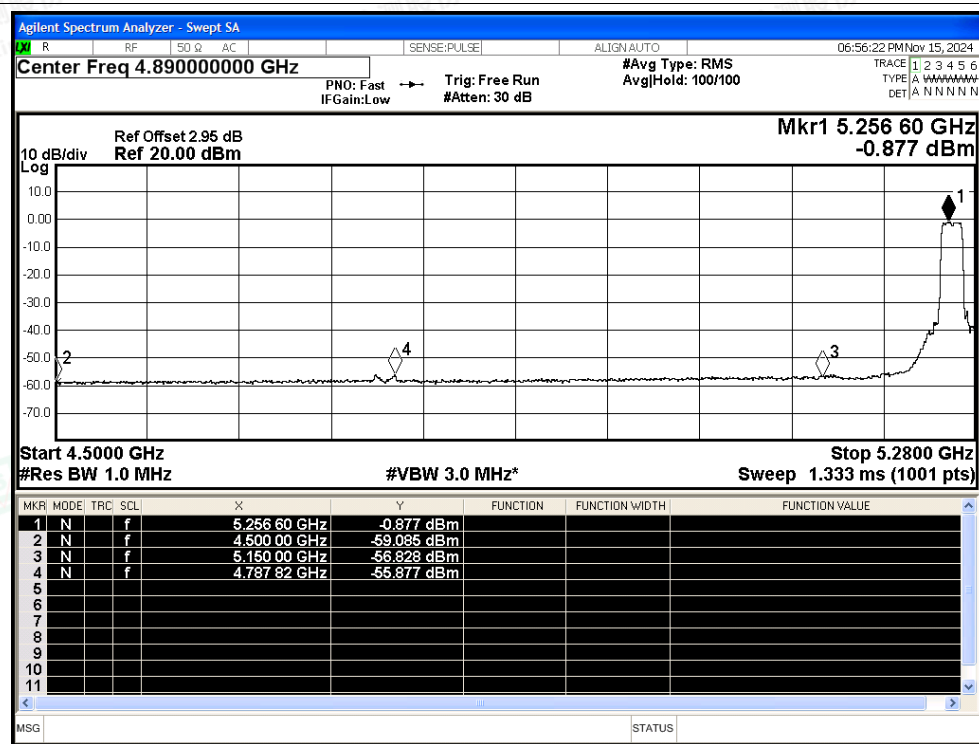

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant4 Peak

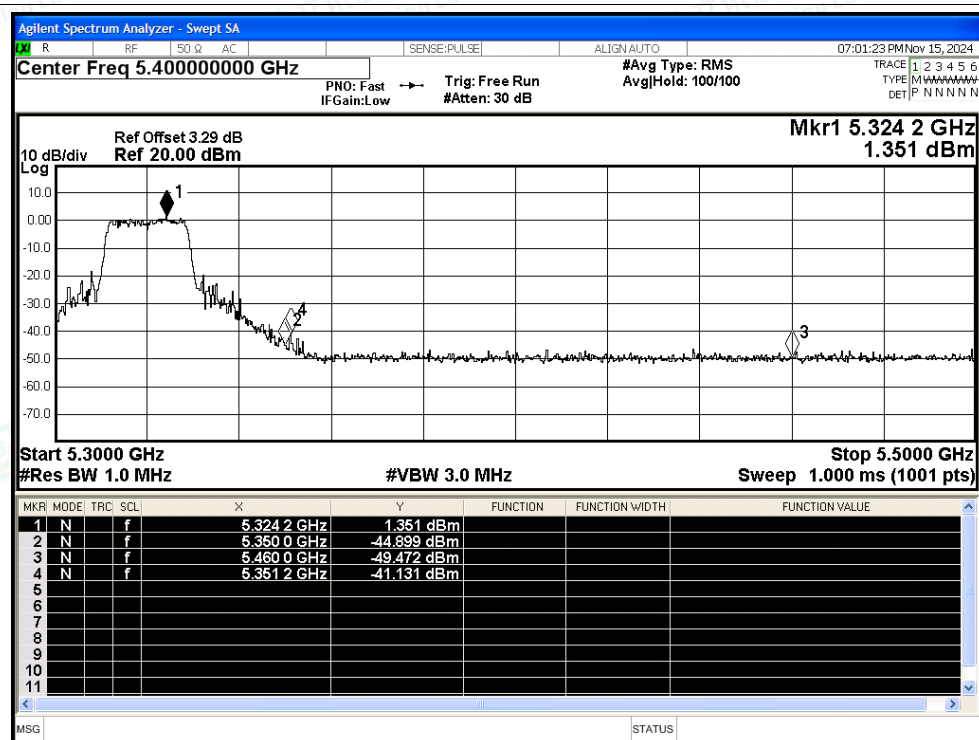


Restrict Band NVNT n20 5320MHz Ant4 Average

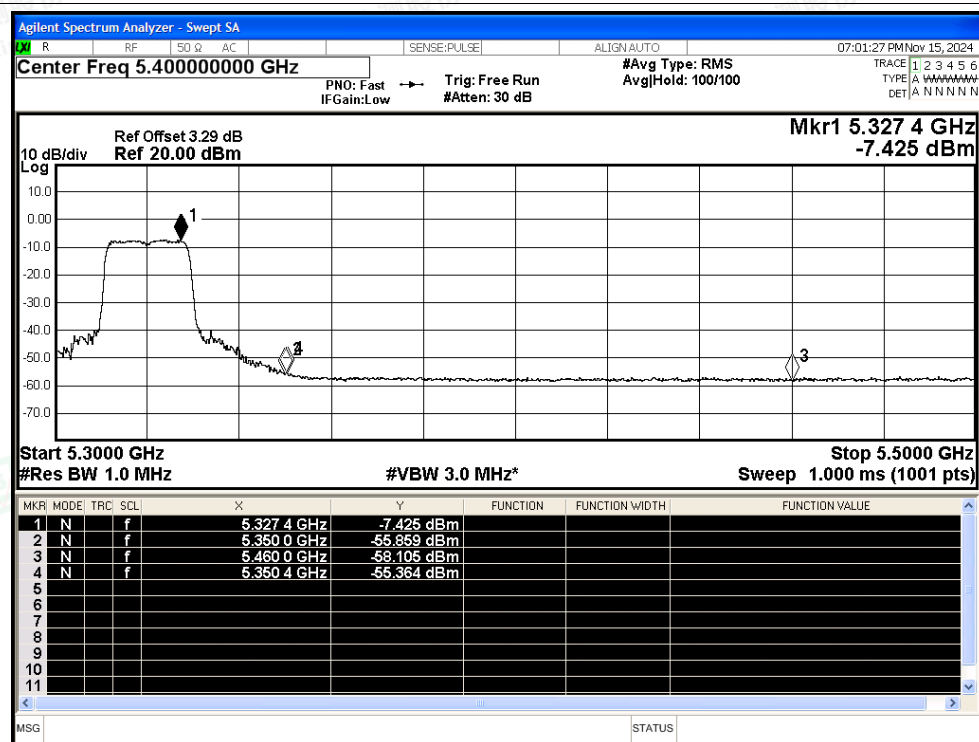




Restrict Band NVNT n40 5270MHz Ant4 Peak

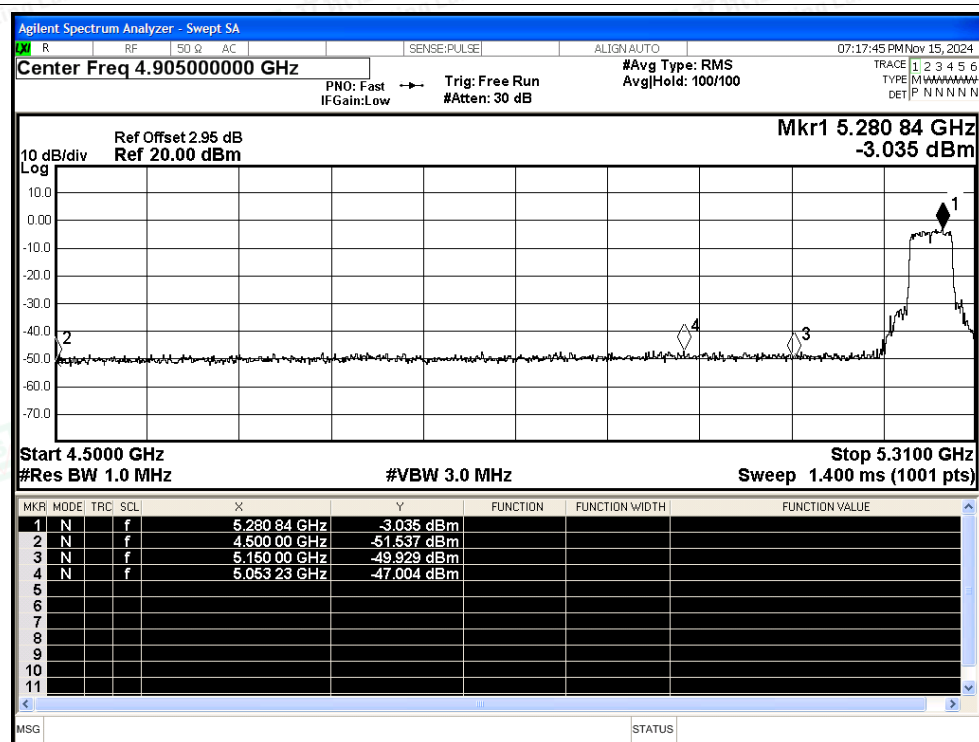

Restrict Band NVNT n40 5270MHz Ant4 Average

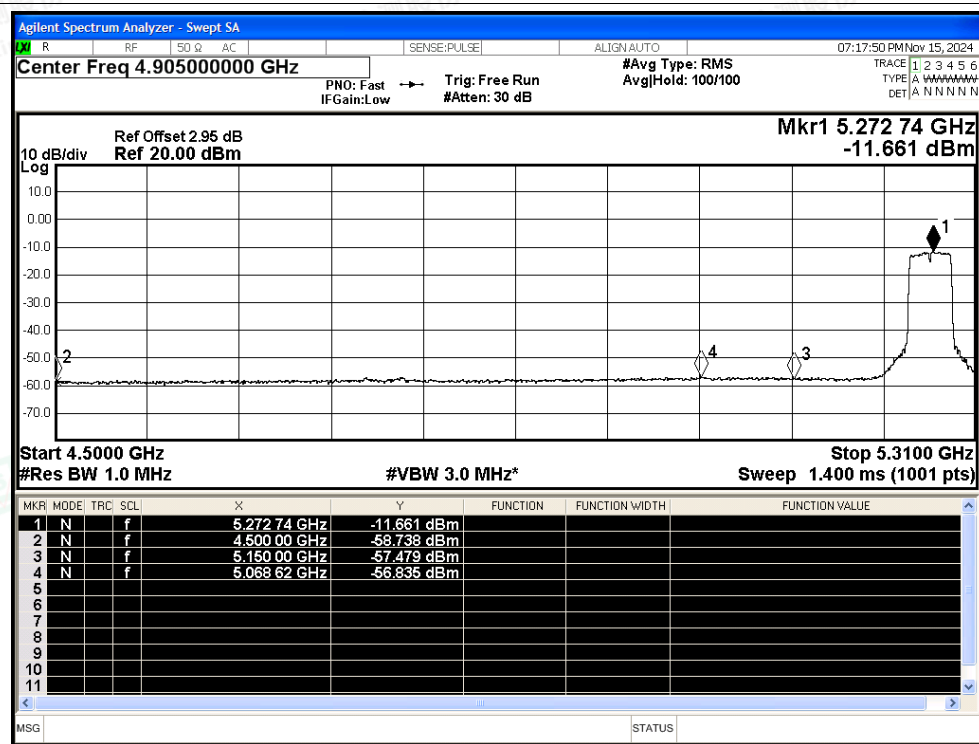

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant4 Peak

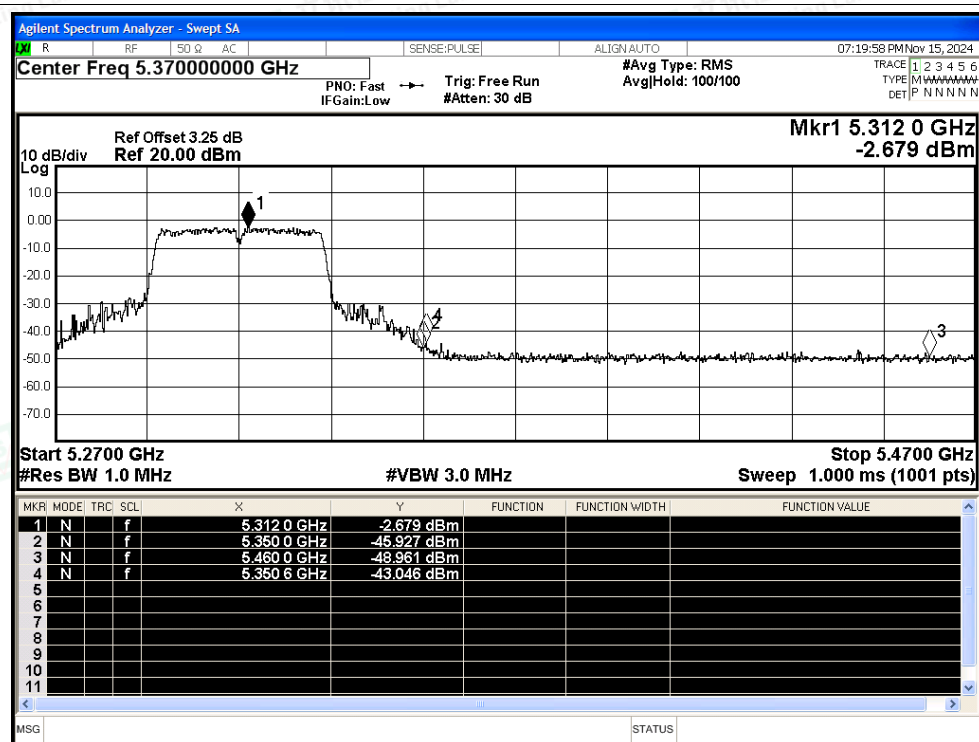

Restrict Band NVNT n40 5310MHz Ant4 Average

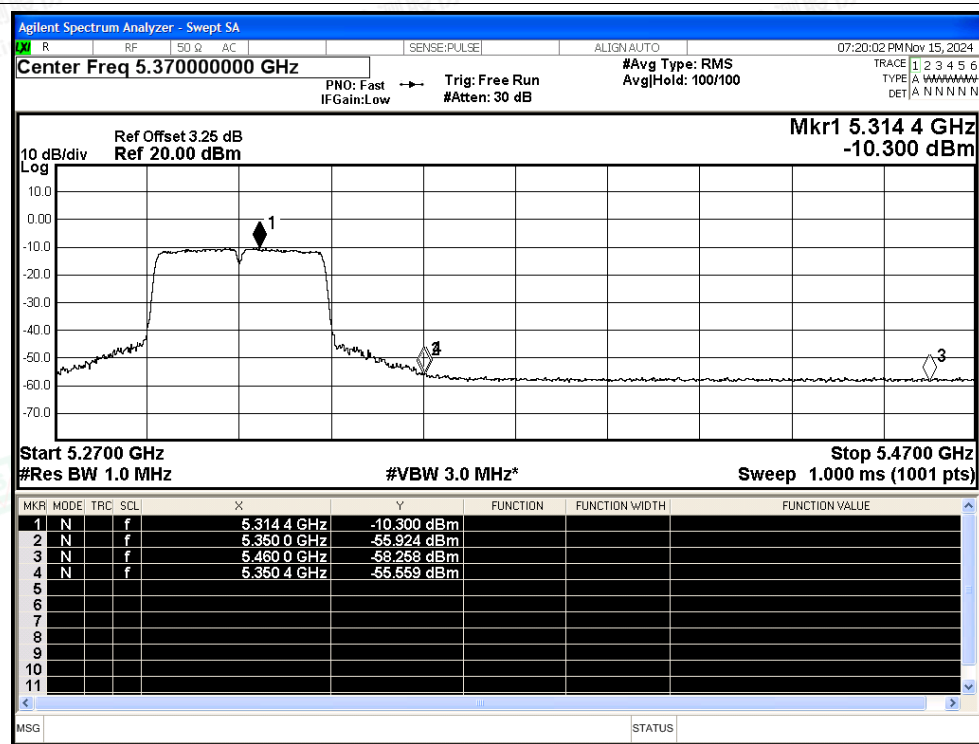

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant4 Peak

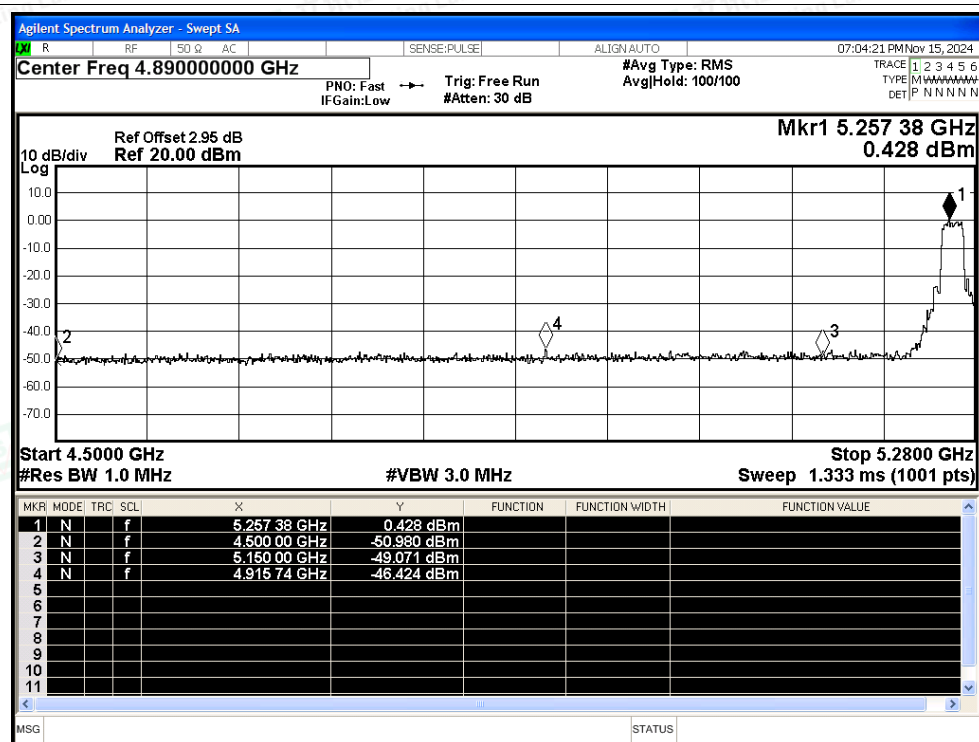


Restrict Band NVNT ac20 5260MHz Ant4 Average

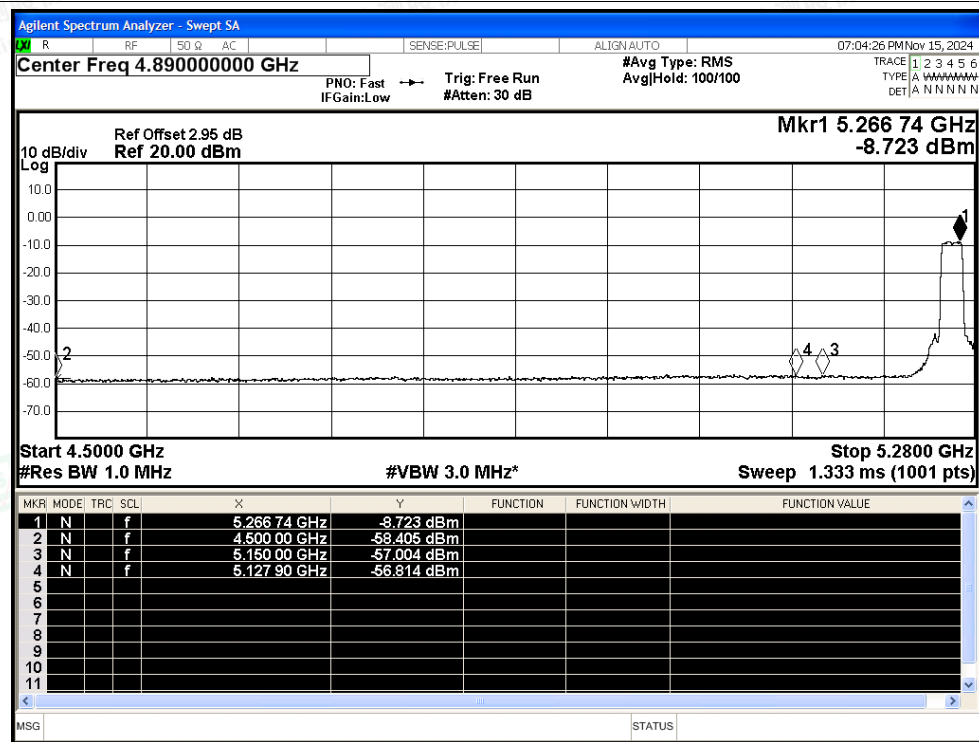




Restrict Band NVNT ac20 5320MHz Ant4 Peak

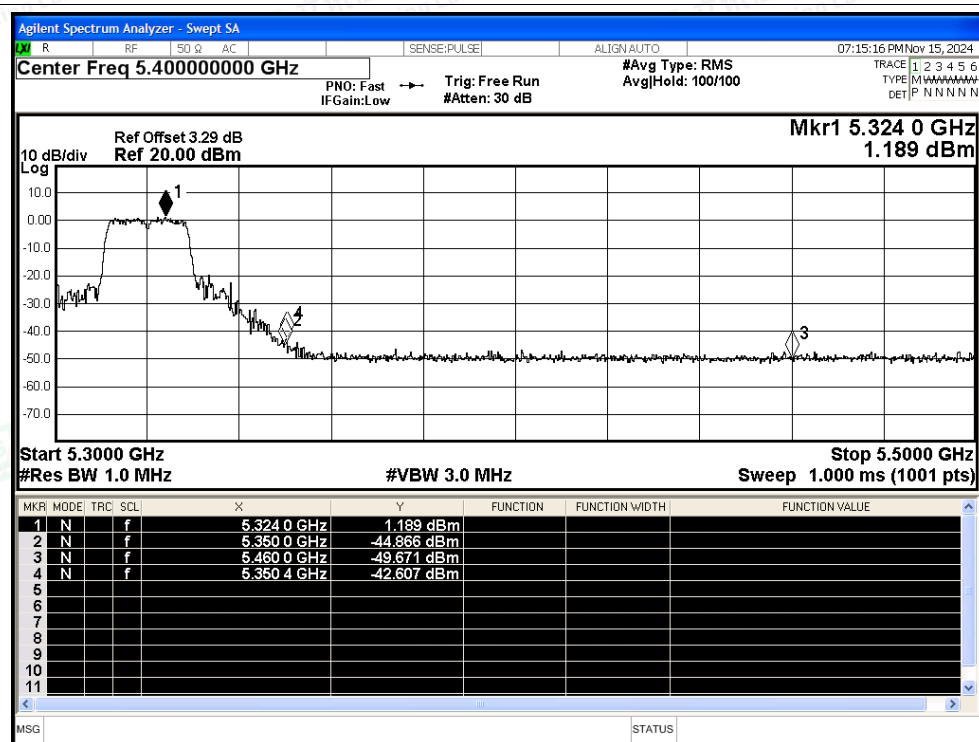

Restrict Band NVNT ac20 5320MHz Ant4 Average

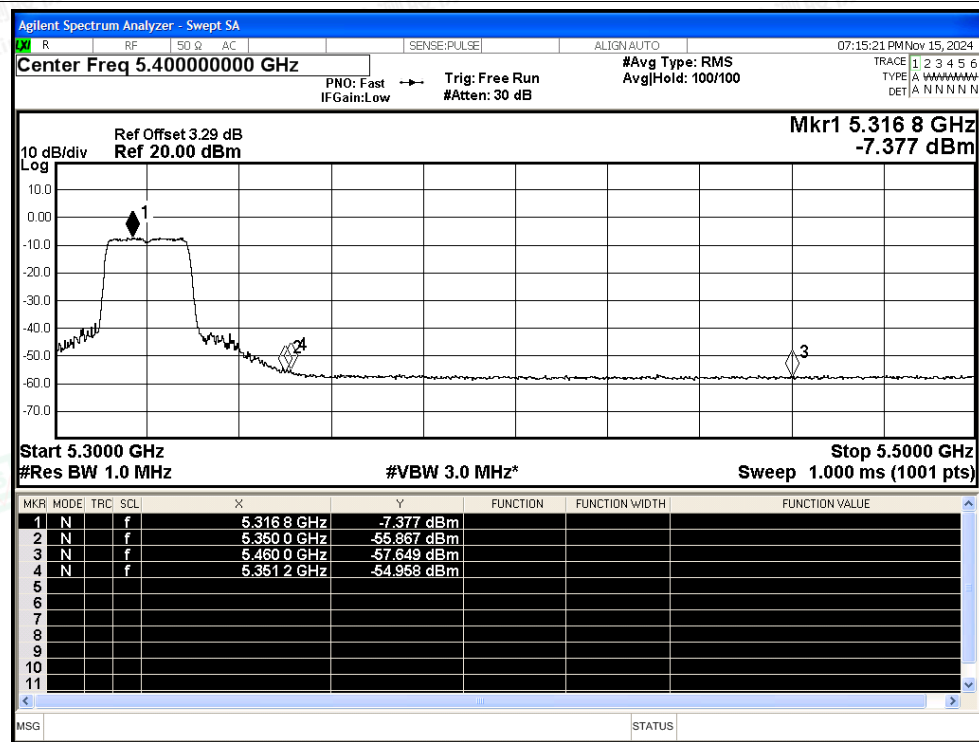

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant4 Peak

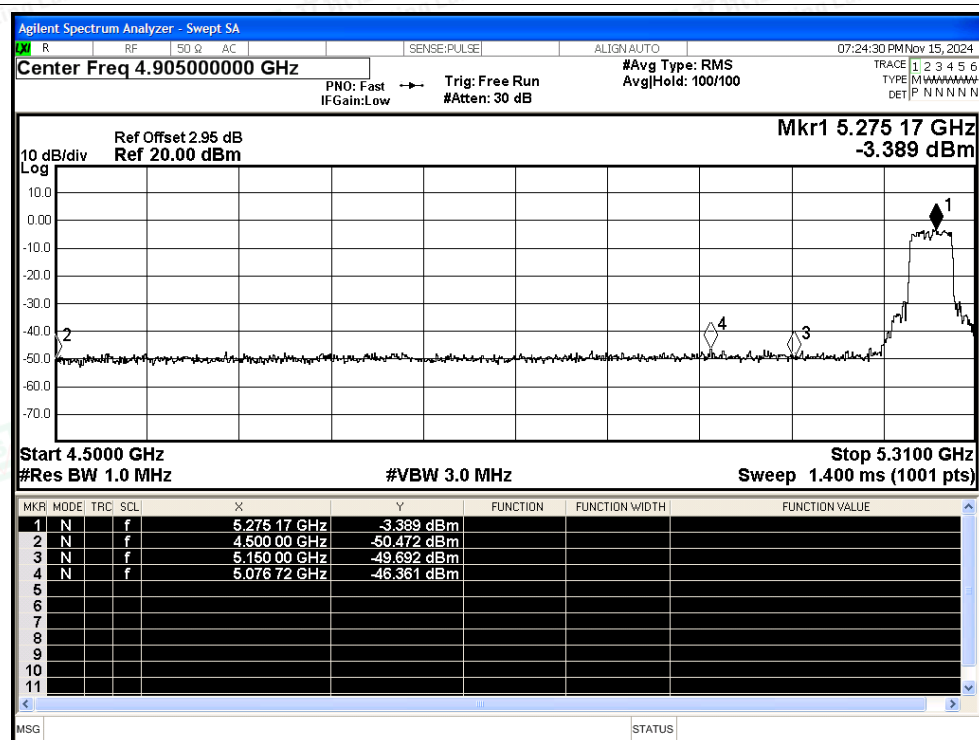

Restrict Band NVNT ac40 5270MHz Ant4 Average

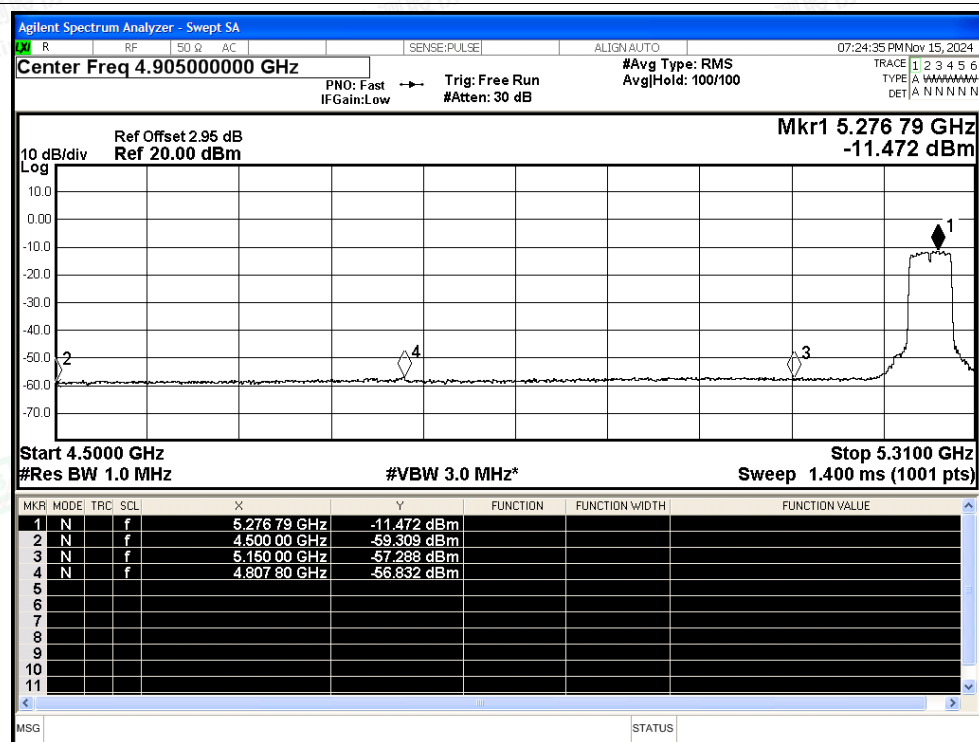

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant4 Peak

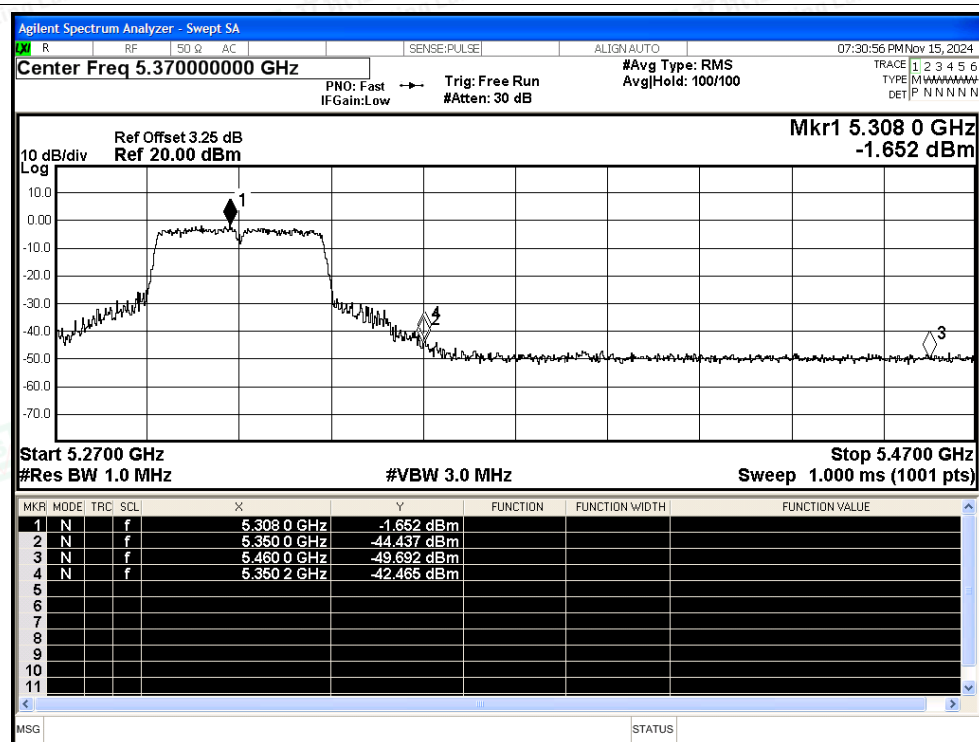

Restrict Band NVNT ac40 5310MHz Ant4 Average

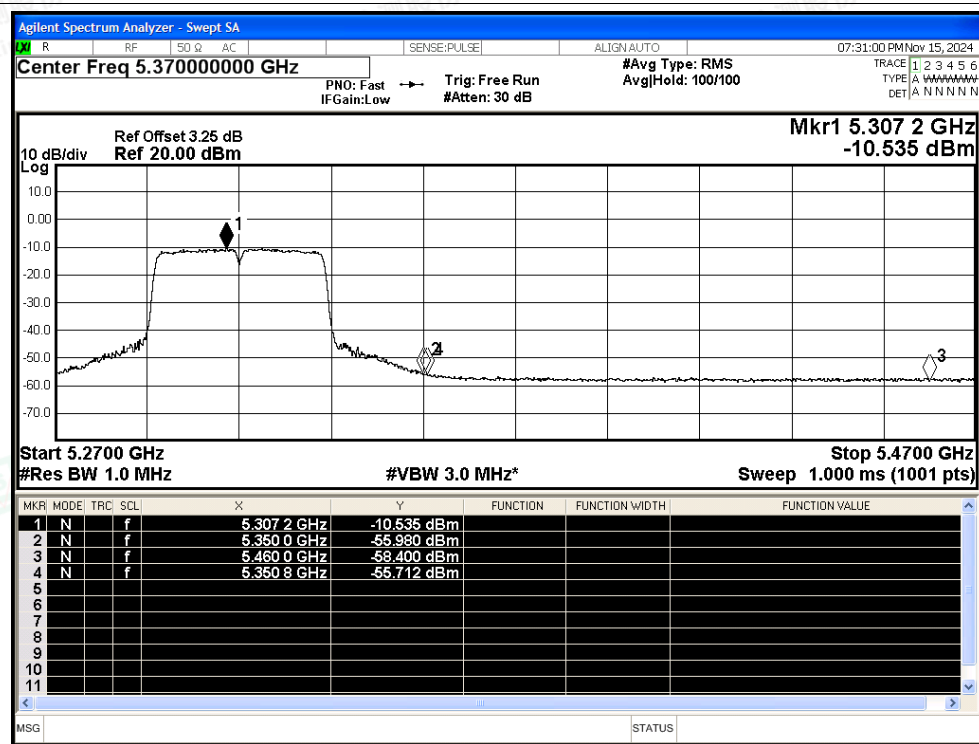

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant4 Peak

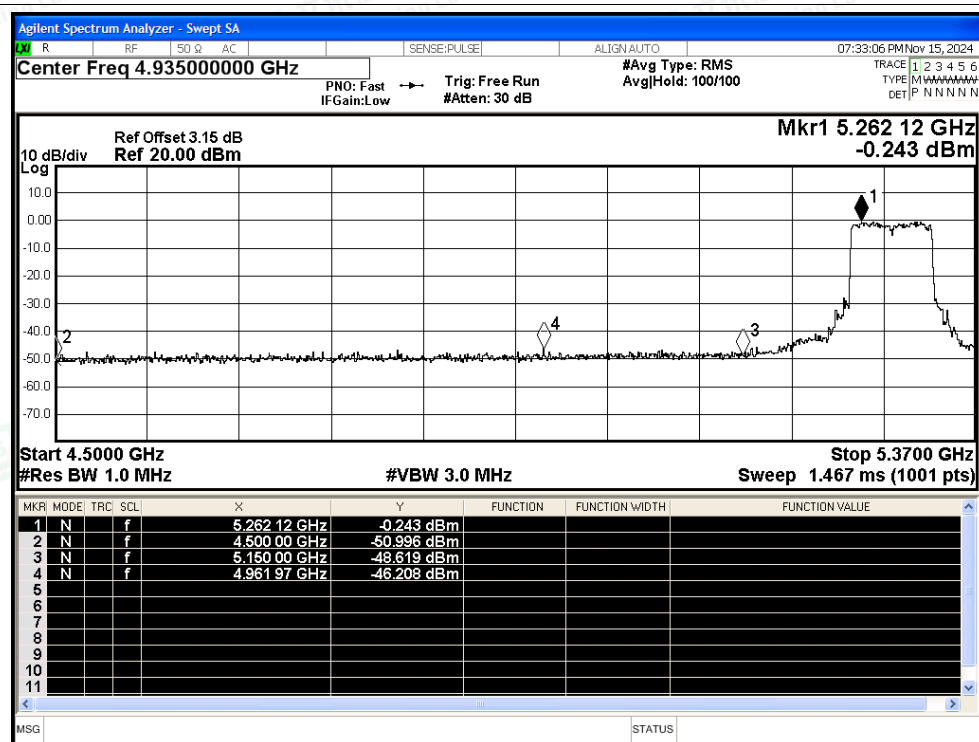

Restrict Band NVNT ac80 5290MHz Ant4 Average

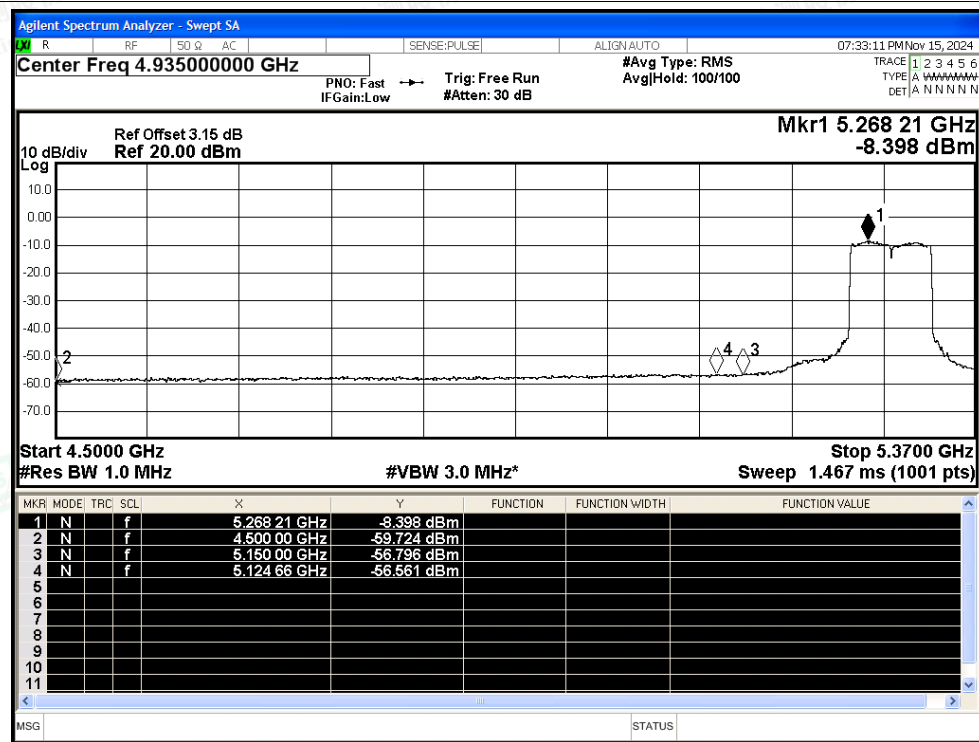

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant4 Peak

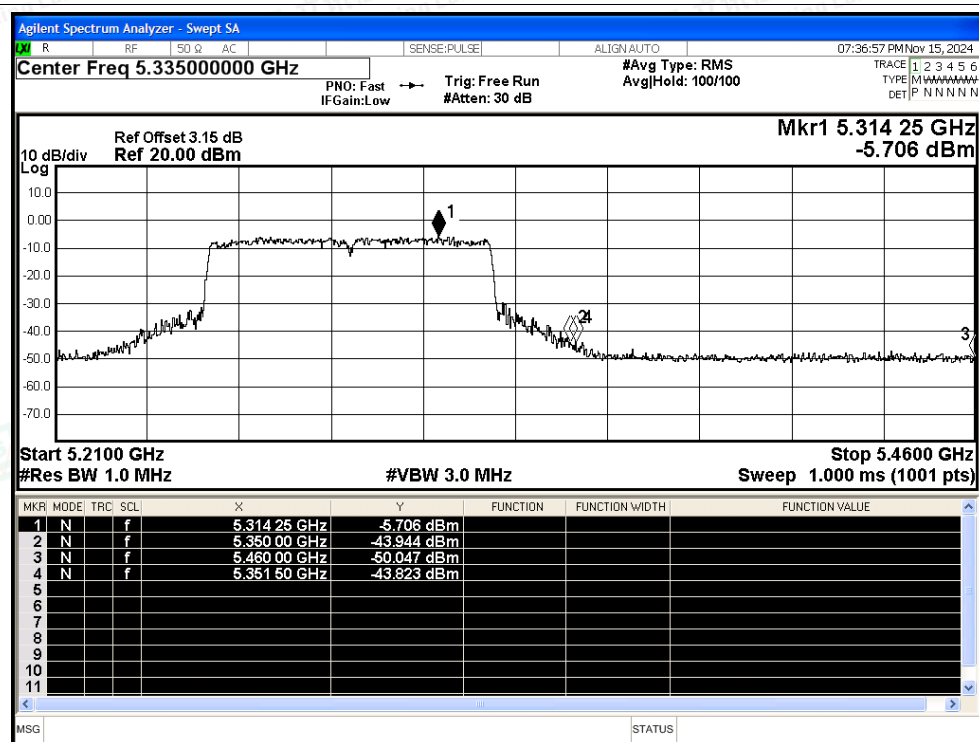

Restrict Band NVNT ac80 5290MHz Ant4 Average

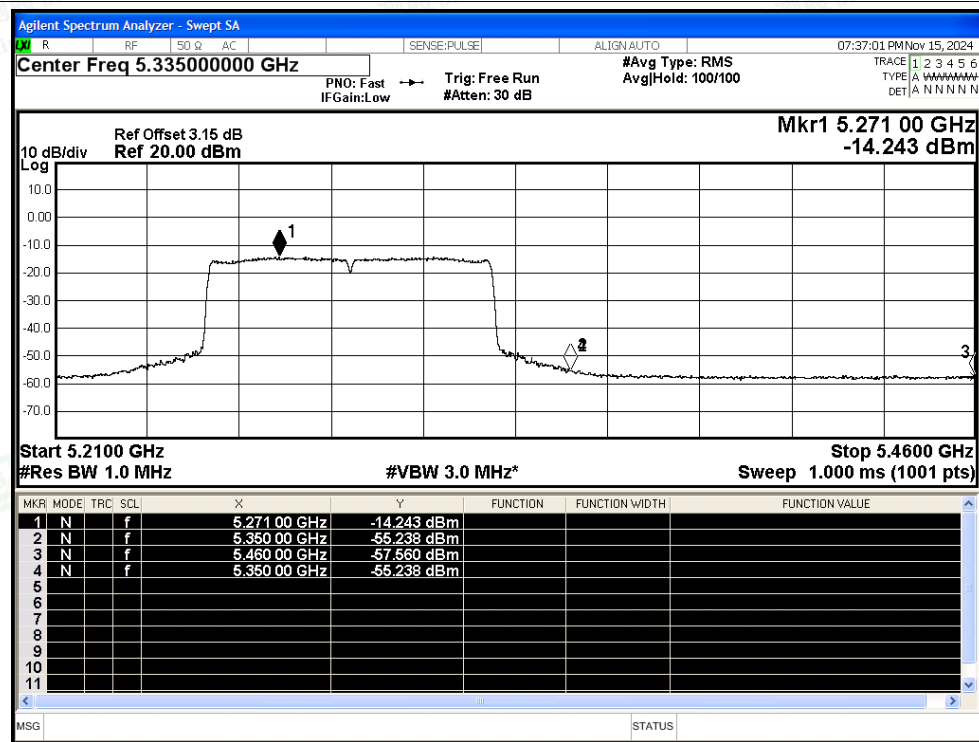

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant4 Peak

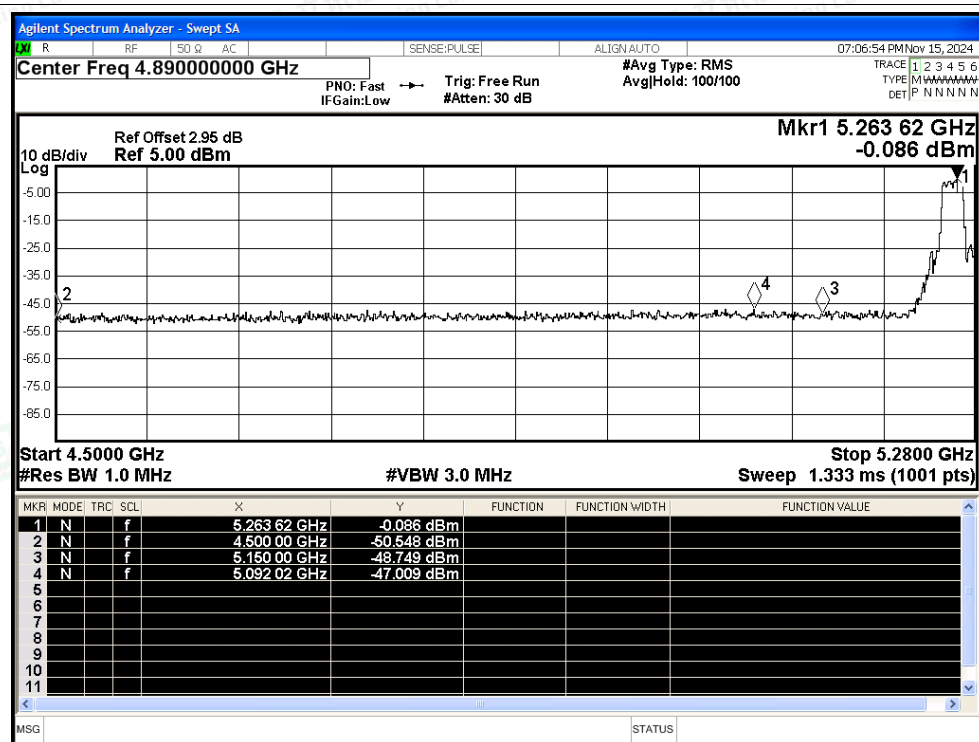

Restrict Band NVNT ax20 5260MHz Ant4 Average

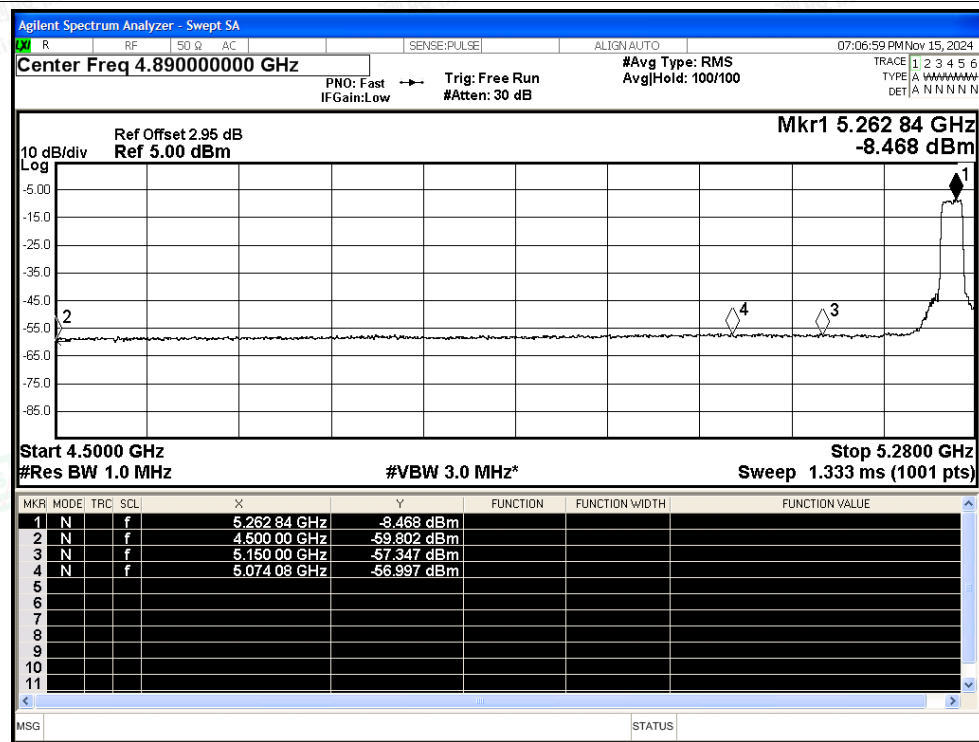

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant4 Peak

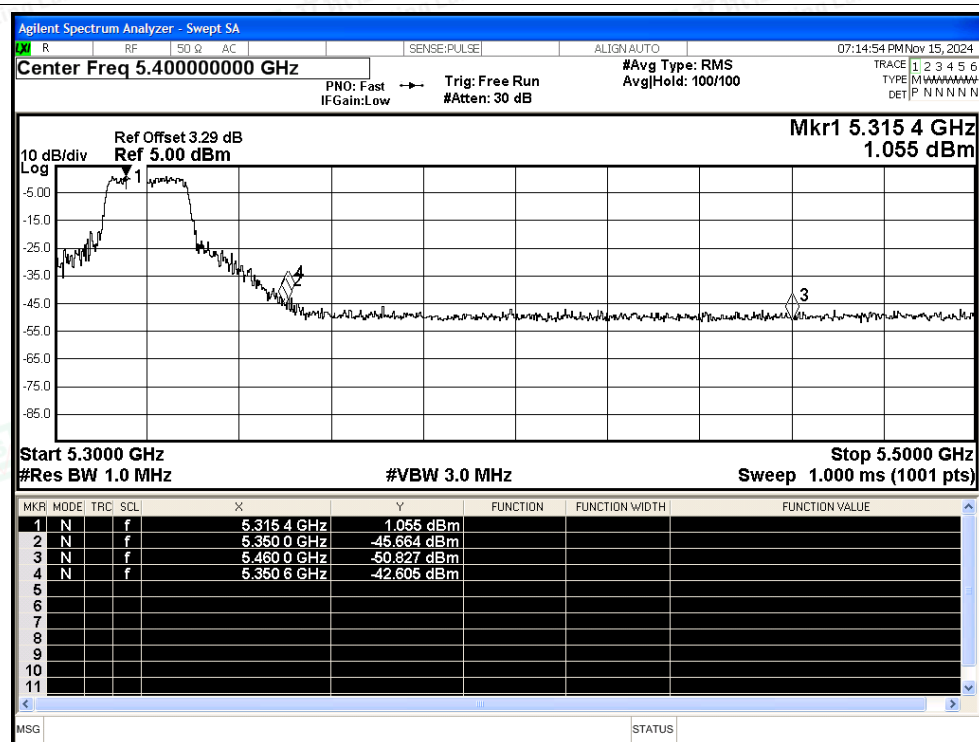

Restrict Band NVNT ax20 5320MHz Ant4 Average

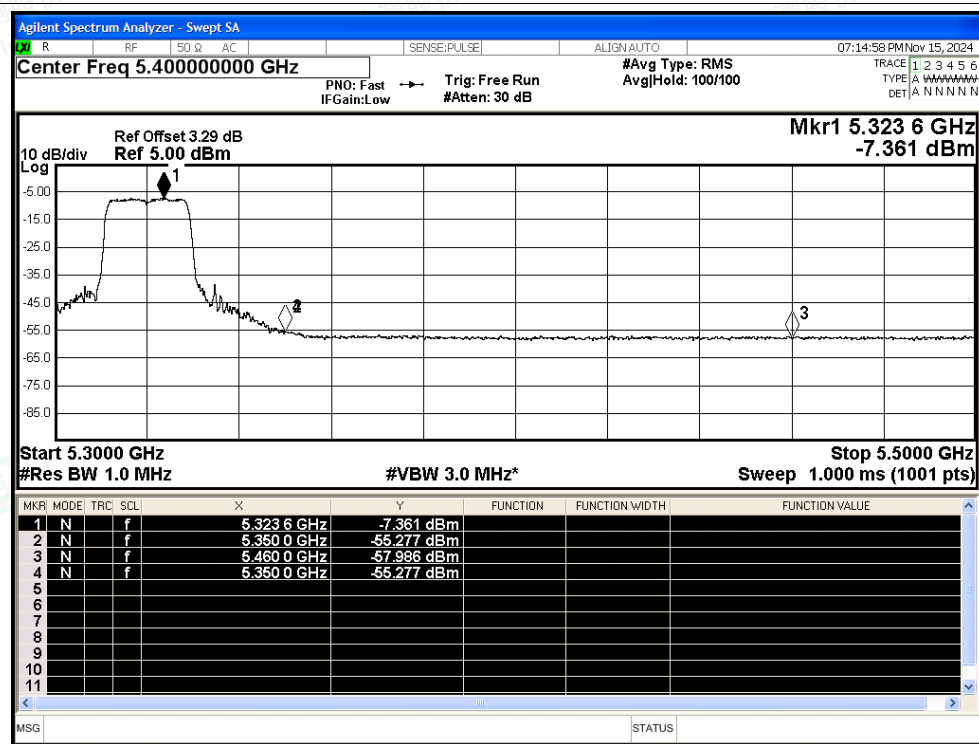

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant4 Peak

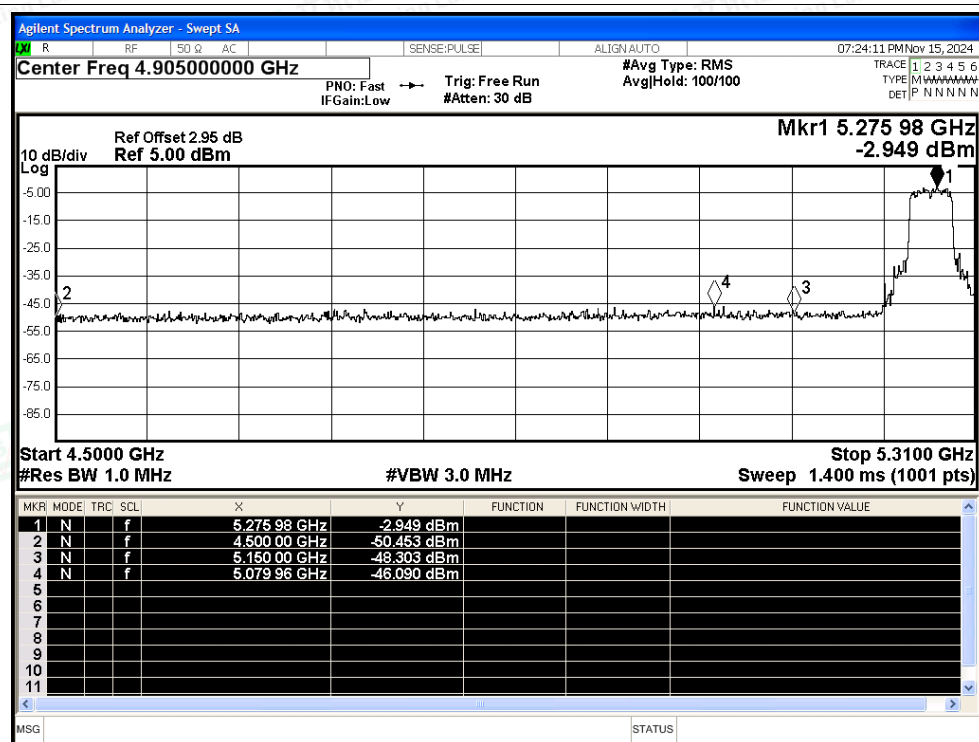

Restrict Band NVNT ax40 5270MHz Ant4 Average

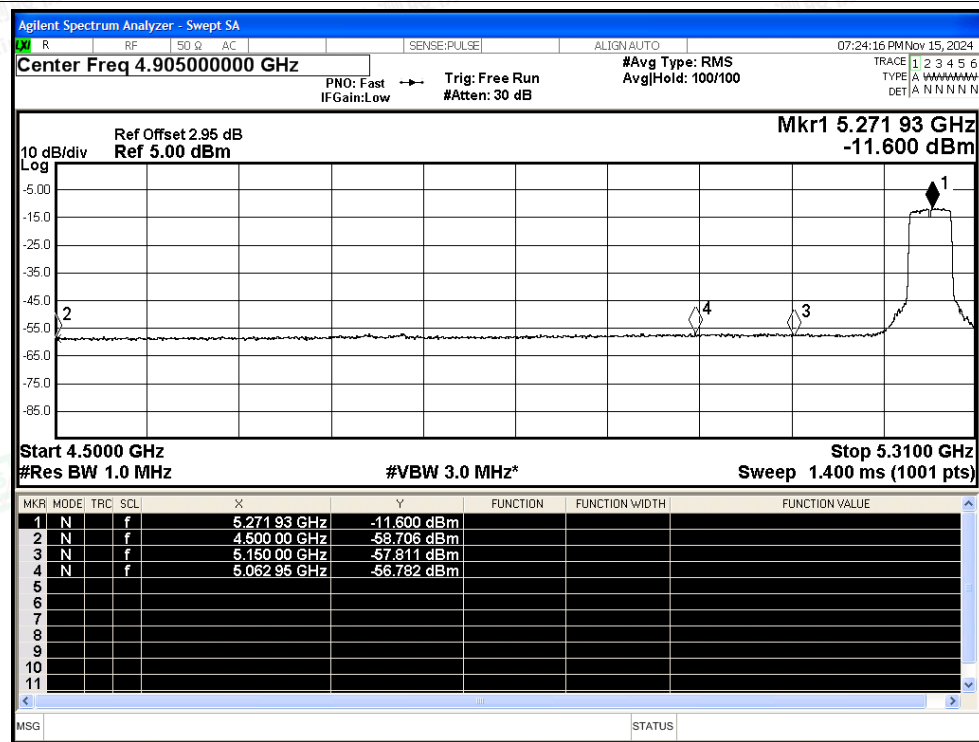

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant4 Peak

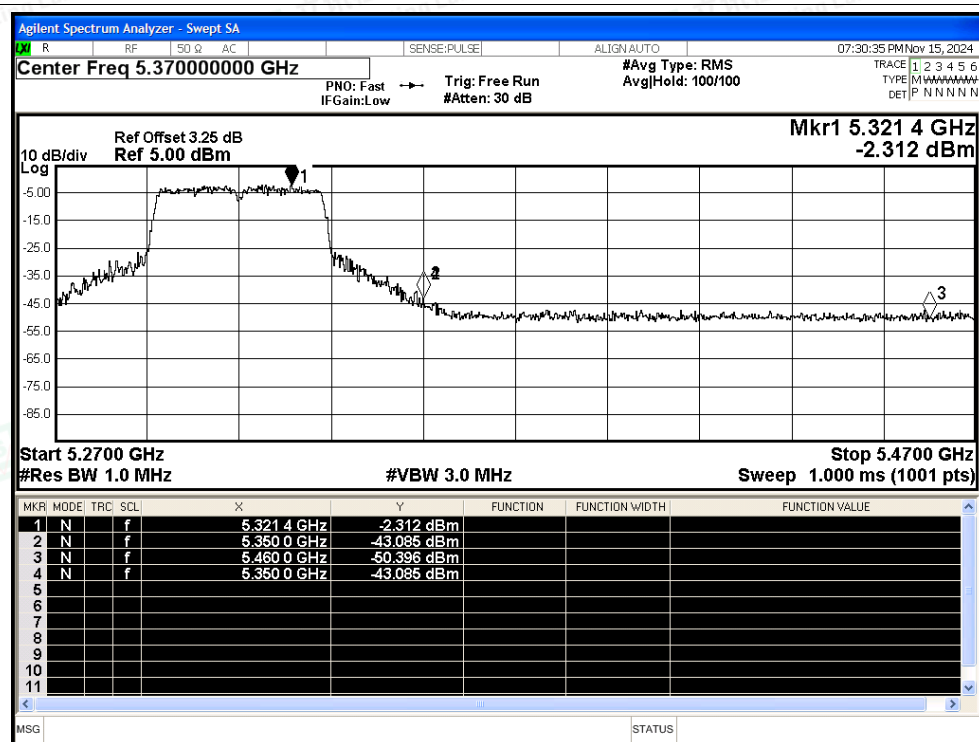

Restrict Band NVNT ax40 5310MHz Ant4 Average

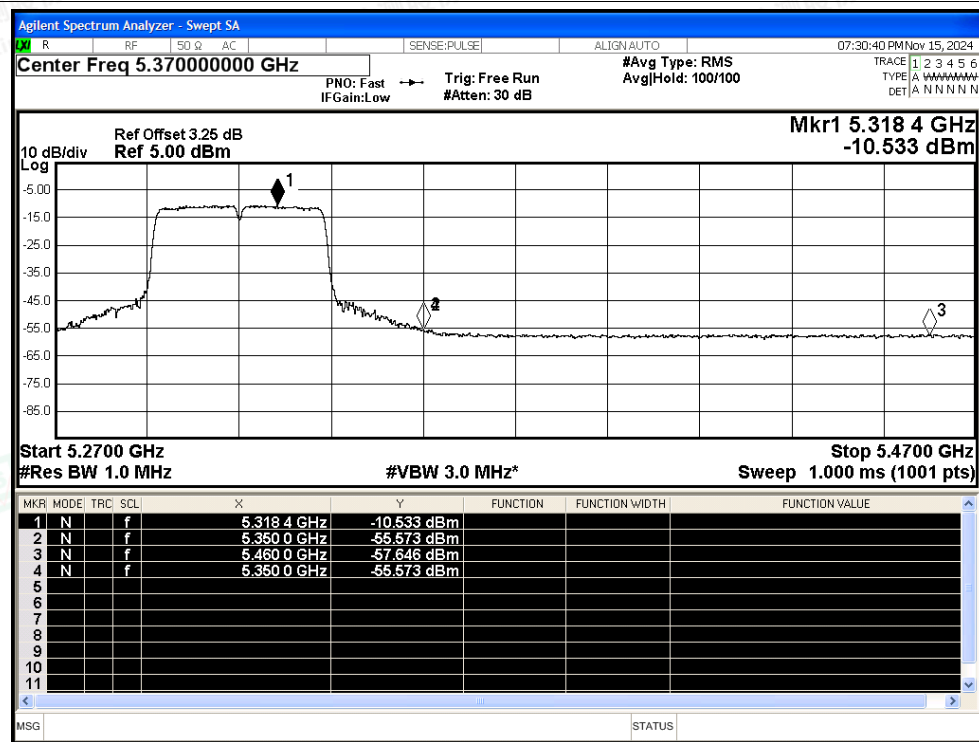

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant4 Peak

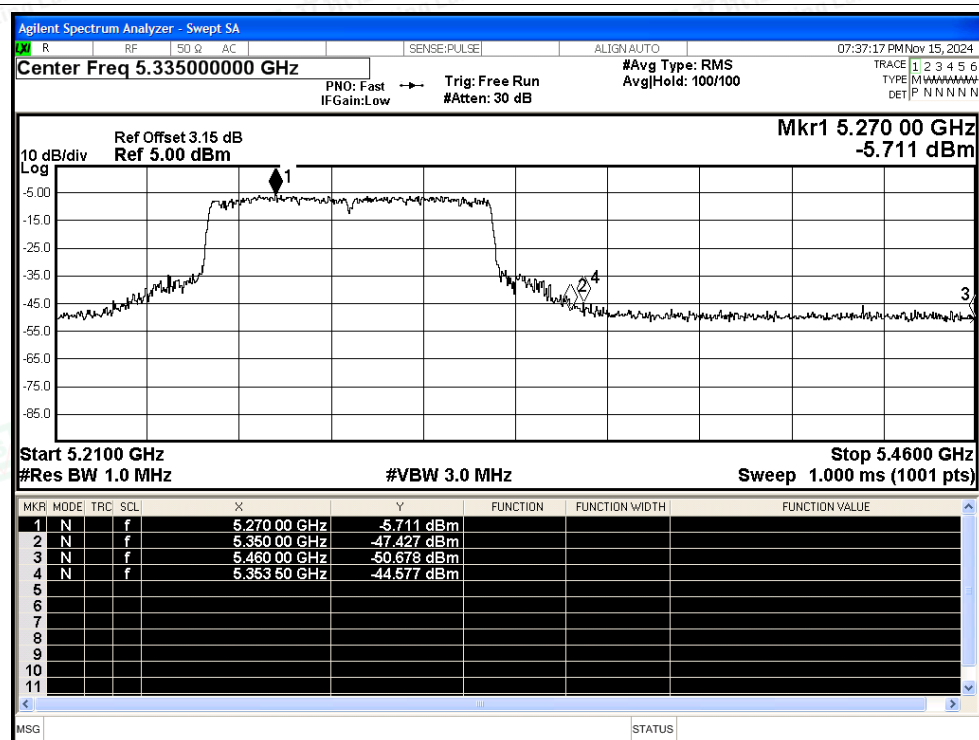

Restrict Band NVNT ax80 5290MHz Ant4 Average

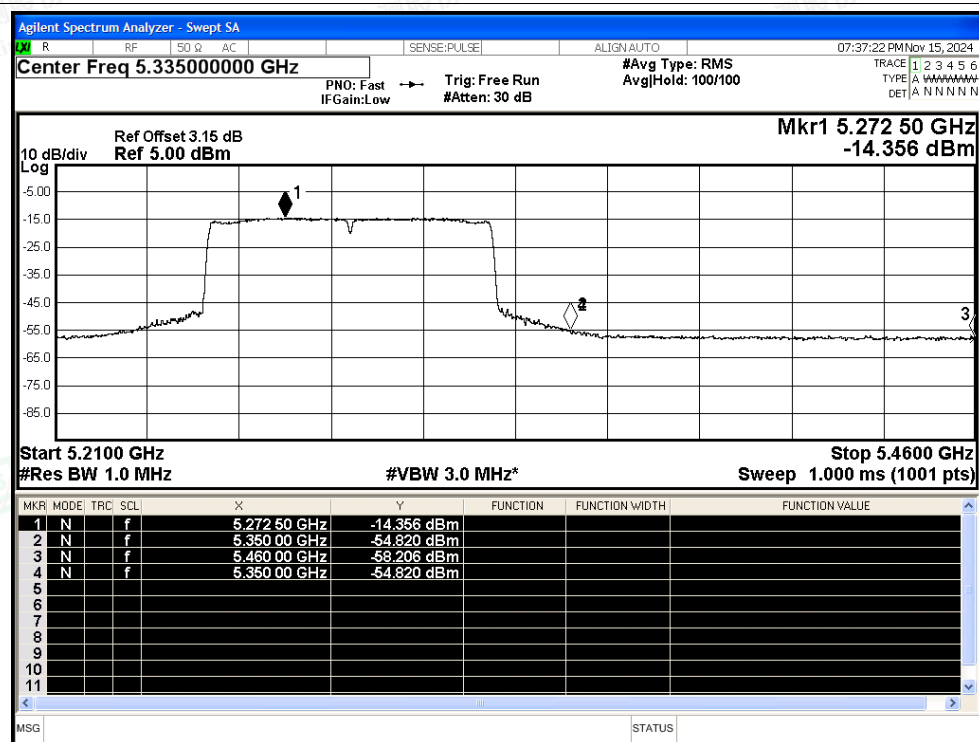

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant4 Peak

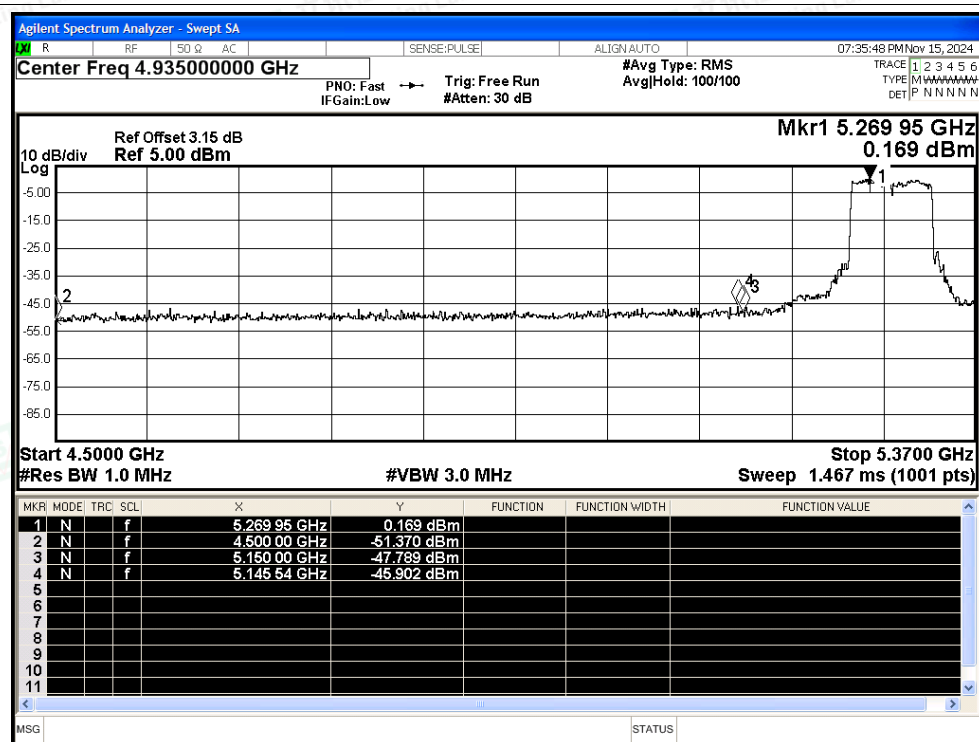

Restrict Band NVNT ax80 5290MHz Ant4 Average

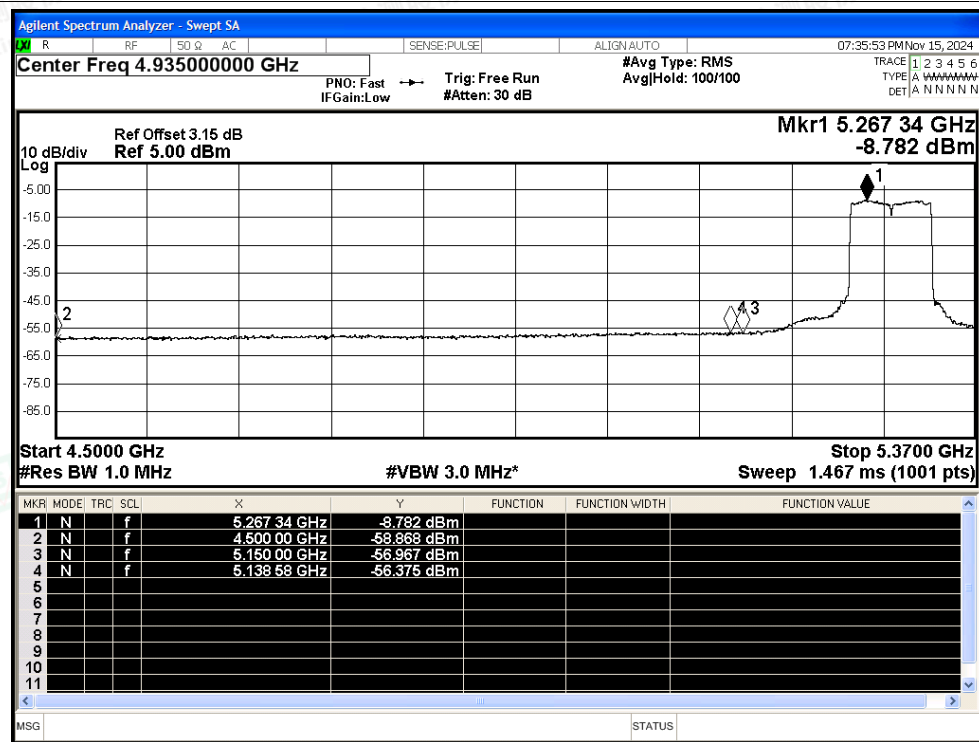

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant4 Peak

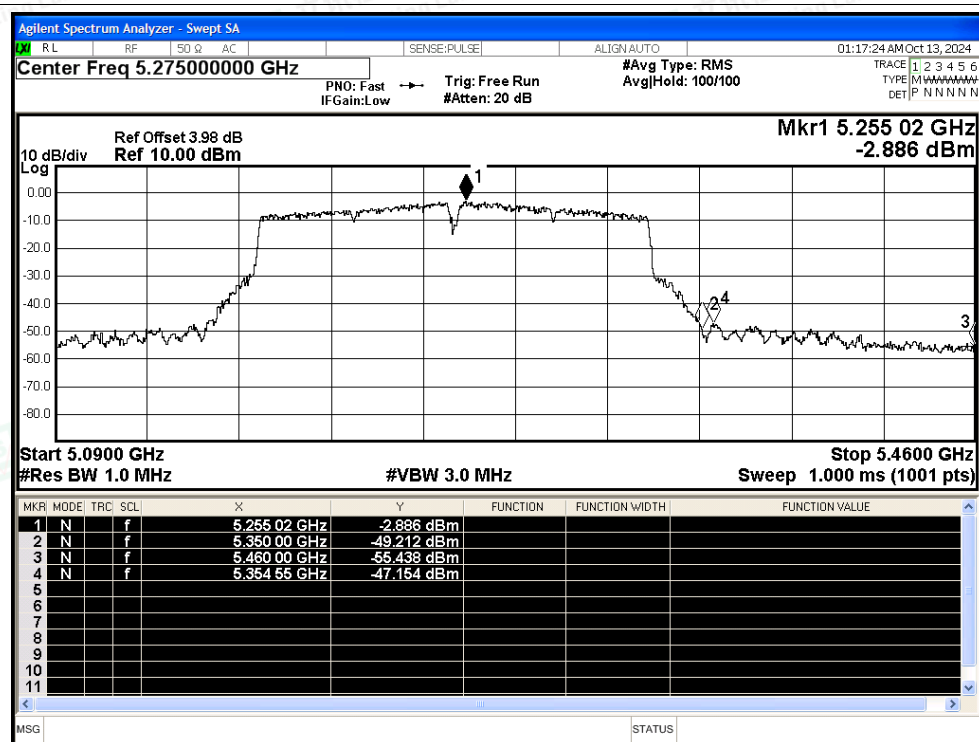

Restrict Band NVNT ac160 5250MHz Ant4 Average

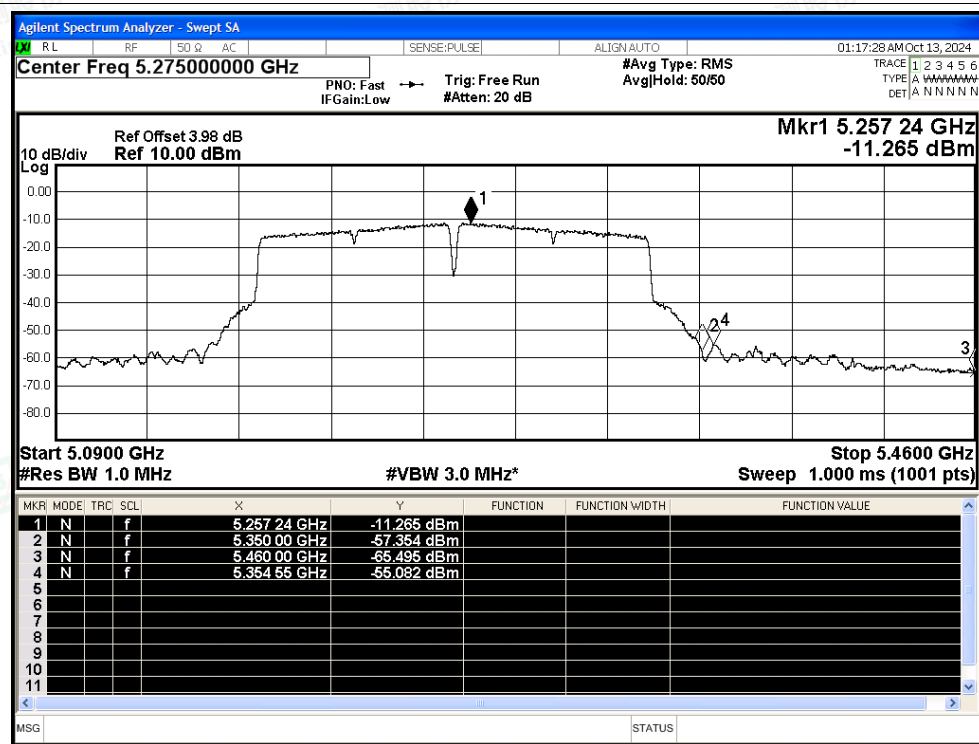

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant4 Peak

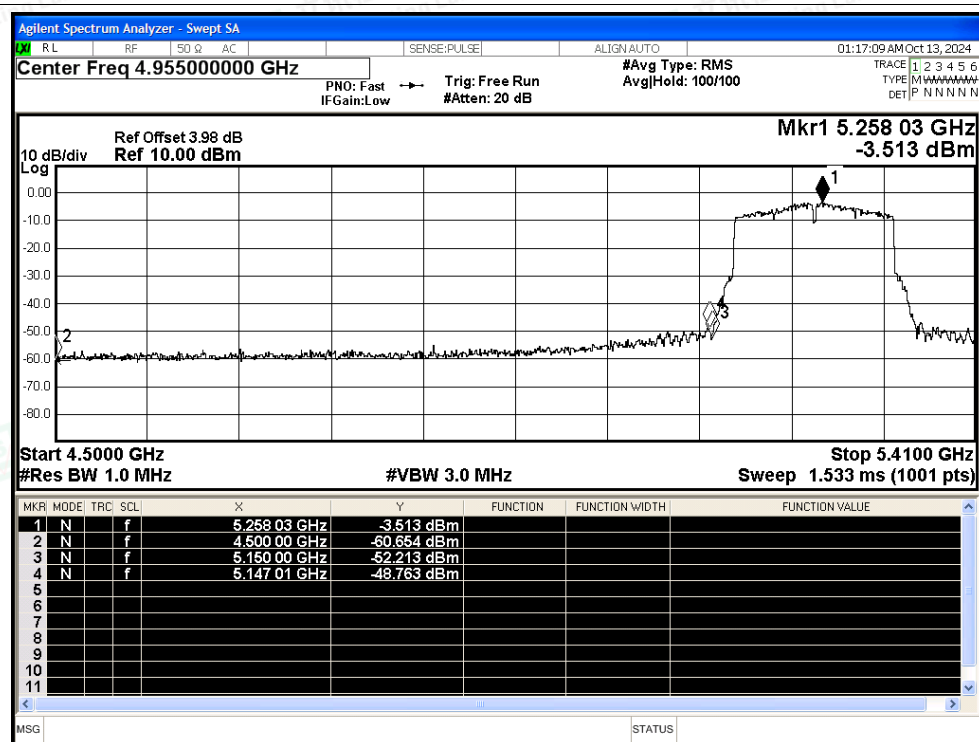

Restrict Band NVNT ac160 5250MHz Ant4 Average

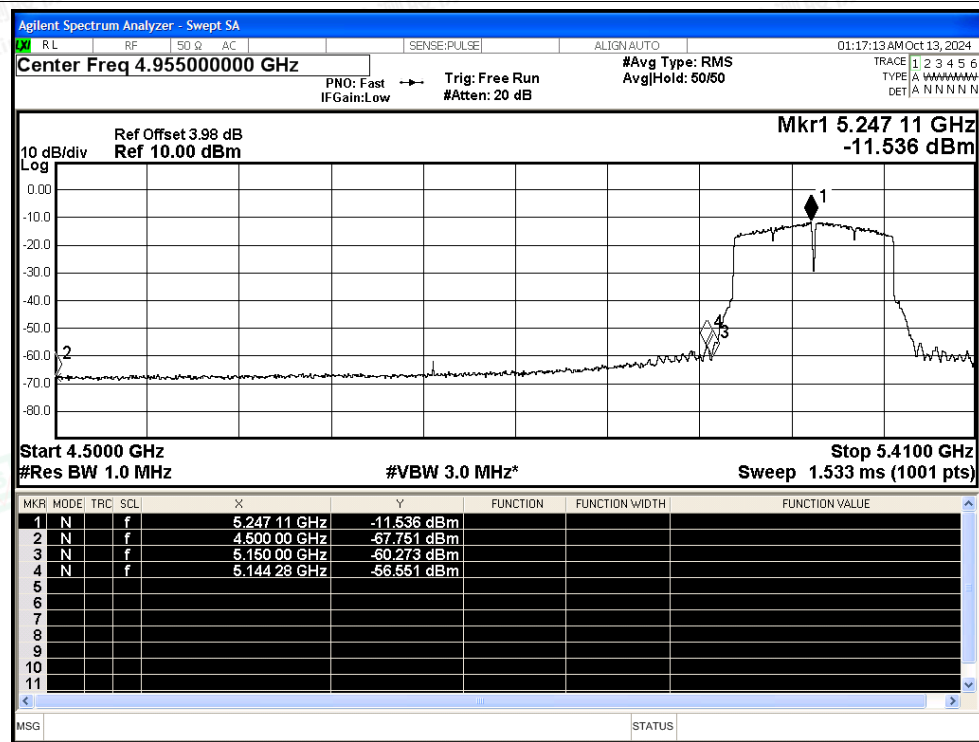

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant4 Peak

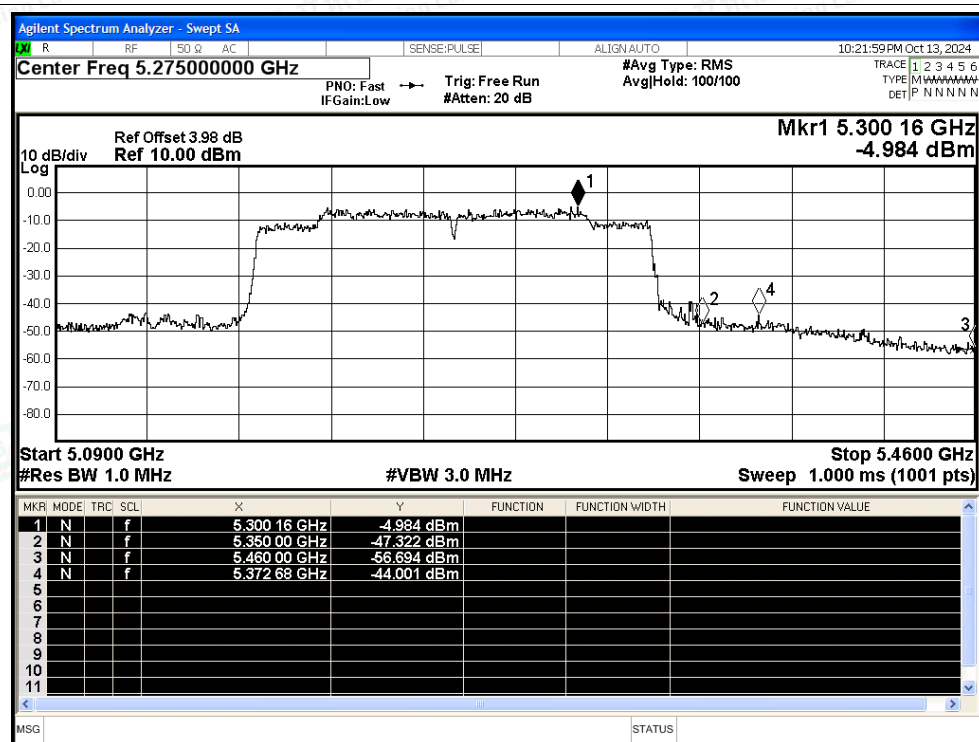


Restrict Band NVNT ax160 5250MHz Ant4 Average

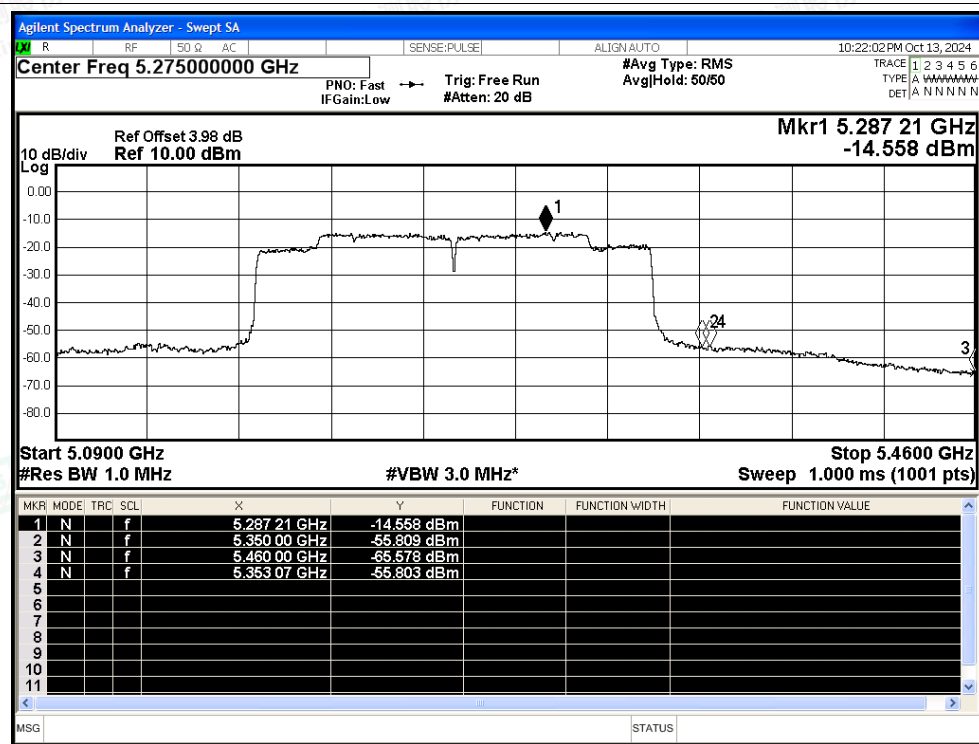




Restrict Band NVNT ax160 5250MHz Ant4 Peak

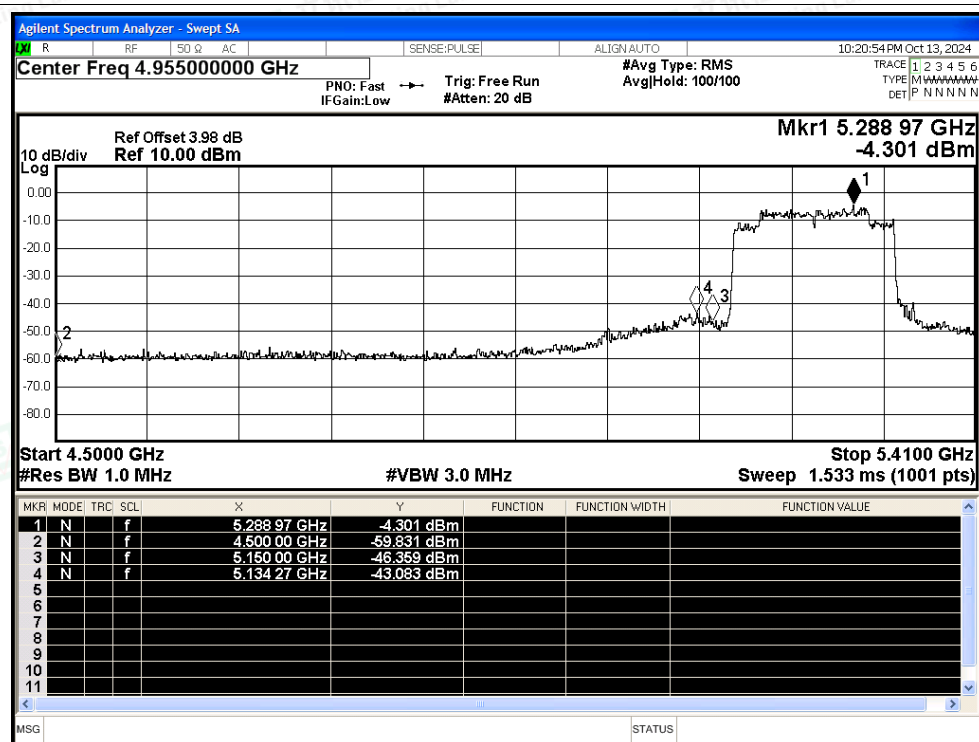

Restrict Band NVNT ax160 5250MHz Ant4 Average

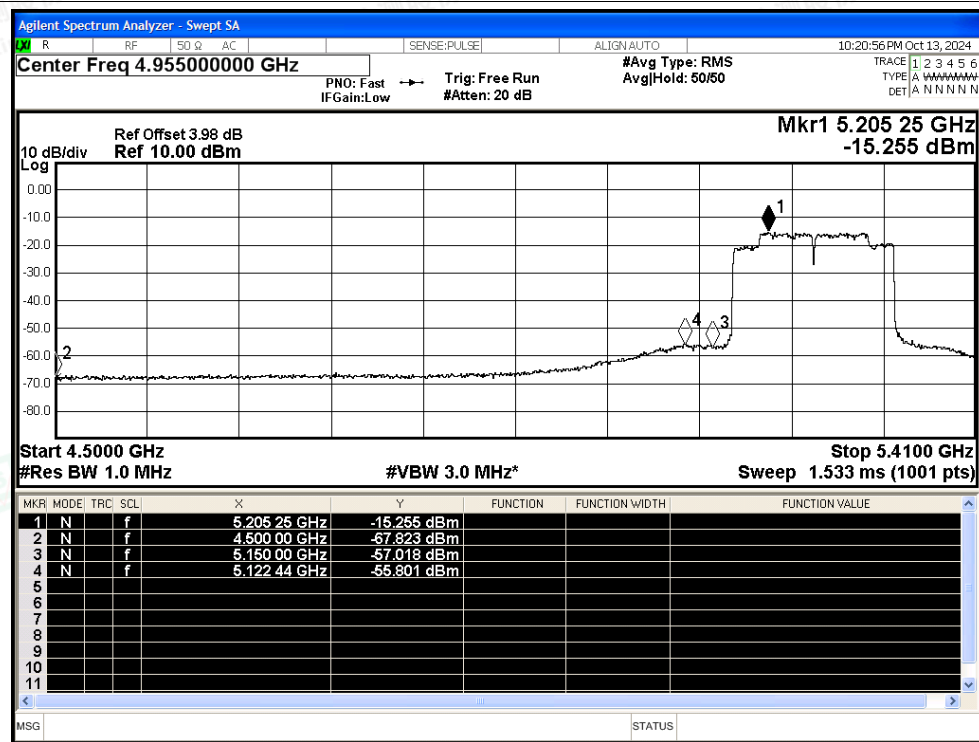



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant3 Power (dBm)	Ant4 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	4500	-51.38	-50.63	8.23	55.48	Peak	68.2	Pass
NVNT	n20	5260	4500	-58.94	-59.09	8.23	47.45	Average	54	Pass
NVNT	n20	5260	4804.98	-46.91	-45.84	8.23	60.13	Peak	68.2	Pass
NVNT	n20	5260	5142.72	-56.91	-55.88	8.23	50.10	Average	54	Pass
NVNT	n20	5260	5150	-49.59	-47.56	8.23	58.01	Peak	68.2	Pass
NVNT	n20	5260	5150	-57.55	-56.83	8.23	49.29	Average	54	Pass
NVNT	n20	5320	5350	-43.21	-44.9	8.23	62.49	Peak	68.2	Pass
NVNT	n20	5320	5350	-54.33	-55.86	8.23	51.44	Average	54	Pass
NVNT	n20	5320	5352.2	-40.32	-41.13	8.23	65.76	Peak	68.2	Pass
NVNT	n20	5320	5350.6	-54.13	-55.36	8.23	51.77	Average	54	Pass
NVNT	n20	5320	5460	-50.99	-49.47	8.23	56.30	Peak	68.2	Pass
NVNT	n20	5320	5460	-57.43	-58.11	8.23	48.71	Average	54	Pass
NVNT	n40	5270	4500	-51.22	-51.54	8.23	55.09	Peak	68.2	Pass
NVNT	n40	5270	4500	-58.72	-58.74	8.23	47.74	Average	54	Pass
NVNT	n40	5270	5092.92	-46.4	-47	8.23	59.78	Peak	68.2	Pass
NVNT	n40	5270	5059.71	-56.73	-56.84	8.23	49.68	Average	54	Pass
NVNT	n40	5270	5150	-50.33	-49.93	8.23	56.34	Peak	68.2	Pass
NVNT	n40	5270	5150	-57.74	-57.48	8.23	48.86	Average	54	Pass
NVNT	n40	5310	5350	-45.07	-45.93	8.23	60.99	Peak	68.2	Pass
NVNT	n40	5310	5350	-55.85	-55.92	8.23	50.58	Average	54	Pass
NVNT	n40	5310	5355.2	-43.61	-43.05	8.23	63.15	Peak	68.2	Pass
NVNT	n40	5310	5351	-55.66	-55.56	8.23	50.86	Average	54	Pass
NVNT	n40	5310	5460	-49.49	-48.96	8.23	57.25	Peak	68.2	Pass
NVNT	n40	5310	5460	-57.66	-58.26	8.23	48.52	Average	54	Pass
NVNT	ac20	5260	4500	-51.64	-50.98	8.23	55.17	Peak	68.2	Pass
NVNT	ac20	5260	4500	-59.25	-58.41	8.23	47.66	Average	54	Pass
NVNT	ac20	5260	4993.74	-47.17	-46.42	8.23	59.69	Peak	68.2	Pass
NVNT	ac20	5260	5067.06	-56.74	-56.81	8.23	49.69	Average	54	Pass
NVNT	ac20	5260	5150	-50.68	-49.07	8.23	56.67	Peak	68.2	Pass
NVNT	ac20	5260	5150	-57.11	-57	8.23	49.41	Average	54	Pass
NVNT	ac20	5320	5350	-44.2	-44.87	8.23	61.95	Peak	68.2	Pass
NVNT	ac20	5320	5350	-55.43	-55.87	8.23	50.82	Average	54	Pass
NVNT	ac20	5320	5350.4	-40.84	-42.61	8.23	64.83	Peak	68.2	Pass
NVNT	ac20	5320	5351	-55.18	-54.96	8.23	51.40	Average	54	Pass
NVNT	ac20	5320	5460	-50.44	-49.67	8.23	56.43	Peak	68.2	Pass
NVNT	ac20	5320	5460	-57.61	-57.65	8.23	48.84	Average	54	Pass
NVNT	ac40	5270	4500	-50.17	-50.47	8.23	56.15	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5270	4500	-59.56	-59.31	8.23	47.03	Average	54	Pass
NVNT	ac40	5270	4971.42	-46.09	-46.36	8.23	60.24	Peak	68.2	Pass
NVNT	ac40	5270	4807.8	-56.75	-56.83	8.23	49.68	Average	54	Pass
NVNT	ac40	5270	5150	-49.36	-49.69	8.23	56.95	Peak	68.2	Pass
NVNT	ac40	5270	5150	-57.55	-57.29	8.23	49.05	Average	54	Pass
NVNT	ac40	5310	5350	-42.14	-44.44	8.23	63.33	Peak	68.2	Pass
NVNT	ac40	5310	5350	-54.83	-55.98	8.23	51.10	Average	54	Pass
NVNT	ac40	5310	5352.4	-41.58	-42.47	8.23	64.47	Peak	68.2	Pass
NVNT	ac40	5310	5350.2	-54.29	-55.71	8.23	51.53	Average	54	Pass
NVNT	ac40	5310	5460	-49.27	-49.69	8.23	56.99	Peak	68.2	Pass
NVNT	ac40	5310	5460	-57.72	-58.4	8.23	48.42	Average	54	Pass
NVNT	ac80	5290	4500	-50.31	-51	8.23	55.83	Peak	68.2	Pass
NVNT	ac80	5290	4500	-58.73	-59.72	8.23	47.27	Average	54	Pass
NVNT	ac80	5290	5120.31	-45.59	-46.21	8.23	60.58	Peak	68.2	Pass
NVNT	ac80	5290	5138.58	-56.21	-56.56	8.23	50.09	Average	54	Pass
NVNT	ac80	5290	5150	-48.6	-48.62	8.23	57.86	Peak	68.2	Pass
NVNT	ac80	5290	5150	-56.55	-56.8	8.23	49.79	Average	54	Pass
NVNT	ac80	5290	5350	-46.21	-43.94	8.23	61.54	Peak	68.2	Pass
NVNT	ac80	5290	5350	-55.75	-55.24	8.23	50.98	Average	54	Pass
NVNT	ac80	5290	5350.75	-42.07	-43.82	8.23	63.61	Peak	68.2	Pass
NVNT	ac80	5290	5351	-55.41	-55.24	8.23	51.14	Average	54	Pass
NVNT	ac80	5290	5460	-49.94	-50.05	8.23	56.47	Peak	68.2	Pass
NVNT	ac80	5290	5460	-57.65	-57.56	8.23	48.86	Average	54	Pass
NVNT	ax20	5260	4500	-50.41	-50.55	8.23	55.99	Peak	68.2	Pass
NVNT	ax20	5260	4500	-58.9	-59.8	8.23	47.14	Average	54	Pass
NVNT	ax20	5260	5117.76	-45.72	-47.01	8.23	60.15	Peak	68.2	Pass
NVNT	ax20	5260	5045.22	-56.73	-57	8.23	49.60	Average	54	Pass
NVNT	ax20	5260	5150	-48.52	-48.75	8.23	57.83	Peak	68.2	Pass
NVNT	ax20	5260	5150	-57.91	-57.35	8.23	48.85	Average	54	Pass
NVNT	ax20	5320	5350	-41.96	-45.66	8.23	63.04	Peak	68.2	Pass
NVNT	ax20	5320	5350	-55.74	-55.28	8.23	50.96	Average	54	Pass
NVNT	ax20	5320	5351.2	-55.59	-42.61	8.23	61.06	Peak	54	Pass
NVNT	ax20	5320	5460	-48.84	-55.28	8.23	55.51	Average	68.2	Pass
NVNT	ax20	5320	5460	-57.68	-50.83	8.23	53.44	Peak	54	Pass
NVNT	ax40	5270	4500	-49.52	-57.99	8.23	54.52	Average	68.2	Pass
NVNT	ax40	5270	4500	-59.19	-50.45	8.23	53.55	Peak	54	Pass
NVNT	ax40	5270	5007.87	-46.37	-58.71	8.23	57.33	Average	68.2	Pass
NVNT	ax40	5270	5018.4	-56.8	-46.09	8.23	57.72	Peak	54	Pass
NVNT	ax40	5270	5150	-49.22	-56.78	8.23	54.94	Average	68.2	Pass
NVNT	ax40	5270	5150	-57.16	-48.3	8.23	55.69	Peak	54	Pass
NVNT	ax40	5310	5350	-45.84	-57.81	8.23	57.89	Average	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5310	5350	-55.5	-43.09	8.23	60.61	Peak	54	Pass
NVNT	ax40	5310	5351.2	-43.58	-55.57	8.23	60.14	Average	68.2	Pass
NVNT	ax40	5310	5460	-49.47	-50.4	8.23	56.56	Peak	68.2	Pass
NVNT	ax40	5310	5460	-58.27	-57.65	8.23	48.52	Average	54	Pass
NVNT	ax80	5290	5350	-44.11	-47.43	8.23	61.01	Peak	68.2	Pass
NVNT	ax80	5290	5350	-55.64	-54.82	8.23	51.26	Average	54	Pass
NVNT	ax80	5290	5352	-43.34	-44.58	8.23	62.55	Peak	68.2	Pass
NVNT	ax80	5290	5351.5	-55.48	-54.82	8.23	51.33	Average	54	Pass
NVNT	ax80	5290	5460	-51.14	-50.68	8.23	55.56	Peak	68.2	Pass
NVNT	ax80	5290	5460	-57.78	-58.21	8.23	48.48	Average	54	Pass
NVNT	ax80	5290	4500	-50.74	-51.37	8.23	55.42	Peak	68.2	Pass
NVNT	ax80	5290	4500	-59.11	-58.87	8.23	47.48	Average	54	Pass
NVNT	ax80	5290	5134.23	-46.53	-45.9	8.23	60.26	Peak	68.2	Pass
NVNT	ax80	5290	5149.02	-56.34	-56.38	8.23	50.11	Average	54	Pass
NVNT	ax80	5290	5150	-49.36	-47.79	8.23	57.96	Peak	68.2	Pass
NVNT	ax80	5290	5150	-56.45	-56.97	8.23	49.77	Average	54	Pass
NVNT	ac160	5250	5350	-49.44	-49.21	8.23	57.14	Peak	68.2	Pass
NVNT	ac160	5250	5350	-56.46	-57.35	8.23	49.59	Average	54	Pass
NVNT	ac160	5250	5353.81	-47.24	-47.15	8.23	59.27	Peak	68.2	Pass
NVNT	ac160	5250	5355.29	-54.87	-55.08	8.23	51.49	Average	54	Pass
NVNT	ac160	5250	5460	-56.97	-55.44	8.23	50.33	Peak	68.2	Pass
NVNT	ac160	5250	5460	-63.03	-65.5	8.23	42.38	Average	54	Pass
NVNT	ac160	5250	4500	-59.11	-60.65	8.23	46.66	Peak	68.2	Pass
NVNT	ac160	5250	4500	-67.45	-67.75	8.23	38.87	Average	54	Pass
NVNT	ac160	5250	5147.01	-47.59	-48.76	8.23	58.33	Peak	68.2	Pass
NVNT	ac160	5250	4874.01	-53.68	-56.55	8.23	51.59	Average	54	Pass
NVNT	ac160	5250	5150	-51.47	-52.21	8.23	54.64	Peak	68.2	Pass
NVNT	ac160	5250	5150	-57.83	-60.27	8.23	47.59	Average	54	Pass
NVNT	ax160	5250	5350	-50.14	-47.32	8.23	57.96	Peak	68.2	Pass
NVNT	ax160	5250	5350	-57.81	-55.81	8.23	49.77	Average	54	Pass
NVNT	ax160	5250	5403.39	-42.6	-44	8.23	63.22	Peak	68.2	Pass
NVNT	ax160	5250	5381.93	-56.76	-55.8	8.23	50.21	Average	54	Pass
NVNT	ax160	5250	5460	-54.41	-56.69	8.23	51.07	Peak	68.2	Pass
NVNT	ax160	5250	5460	-62.95	-65.58	8.23	42.40	Average	54	Pass
NVNT	ax160	5250	4500	-60.05	-59.83	8.23	46.53	Peak	68.2	Pass
NVNT	ax160	5250	4500	-68.03	-67.82	8.23	38.54	Average	54	Pass
NVNT	ax160	5250	5137.91	-44.95	-43.08	8.23	62.55	Peak	68.2	Pass
NVNT	ax160	5250	5137	-58.38	-55.8	8.23	49.57	Average	54	Pass
NVNT	ax160	5250	5150	-49.18	-46.36	8.23	58.92	Peak	68.2	Pass
NVNT	ax160	5250	5150	-59.13	-57.02	8.23	48.52	Average	54	Pass
NVNT	ax160	5250	5150	-49.18	-46.36	8.23	58.92	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax160	5250	5150	-59.13	-57.02	8.23	48.52	Average	54	Pass
------	-------	------	------	--------	--------	------	-------	---------	----	------



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



C.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant3	5259.98	-20000	-3.8	25	Pass
NVNT	a	5300	Ant3	5299.98	-20000	-3.77	25	Pass
NVNT	a	5320	Ant3	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant3	5259.98	-20000	-3.8	25	Pass
NVNT	n20	5300	Ant3	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant3	5320	0	0	25	Pass
NVNT	n40	5270	Ant3	5269.96	-40000	-7.59	25	Pass
NVNT	n40	5310	Ant3	5310	0	0	25	Pass
NVNT	ac20	5260	Ant3	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant3	5300	0	0	25	Pass
NVNT	ac20	5320	Ant3	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant3	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant3	5310	0	0	25	Pass
NVNT	ac80	5290	Ant3	5290	0	0	25	Pass
NVNT	ax20	5260	Ant3	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5300	Ant3	5300	0	0	25	Pass
NVNT	ax20	5320	Ant3	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant3	5269.96	-40000	-7.59	25	Pass
NVNT	ax40	5310	Ant3	5309.96	-40000	-7.53	25	Pass
NVNT	ax80	5290	Ant3	5290	0	0	25	Pass
NVNT	ac160	5250	Ant3	5250	0	0	25	Pass
NVNT	ax160	5250	Ant3	5250	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant3

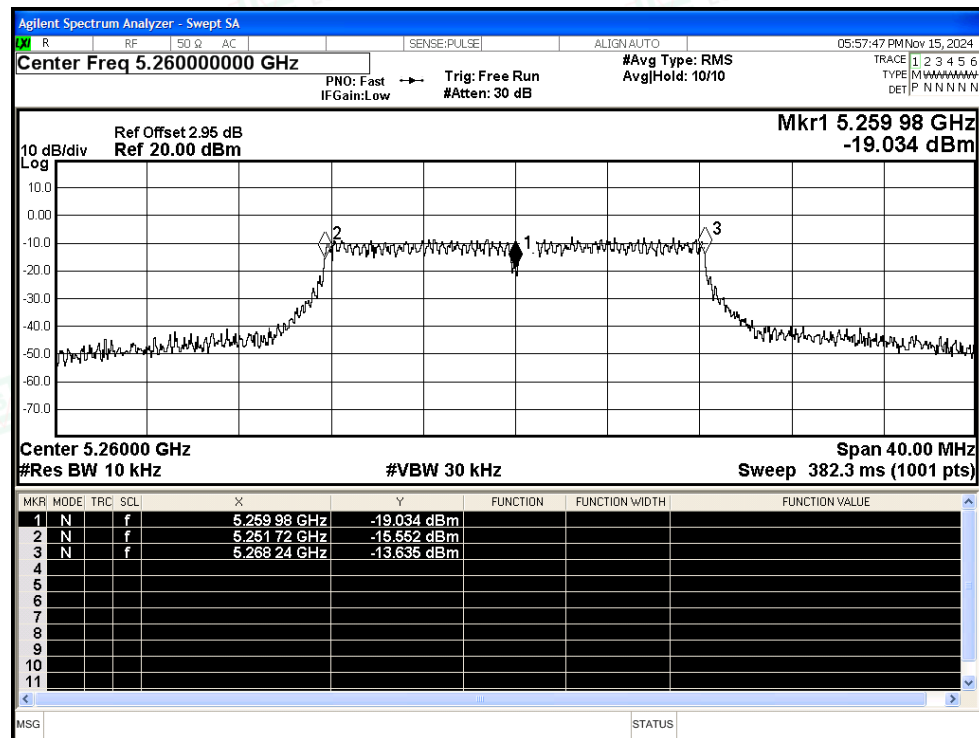

Freq. Stability NVNT a 5300MHz Ant3

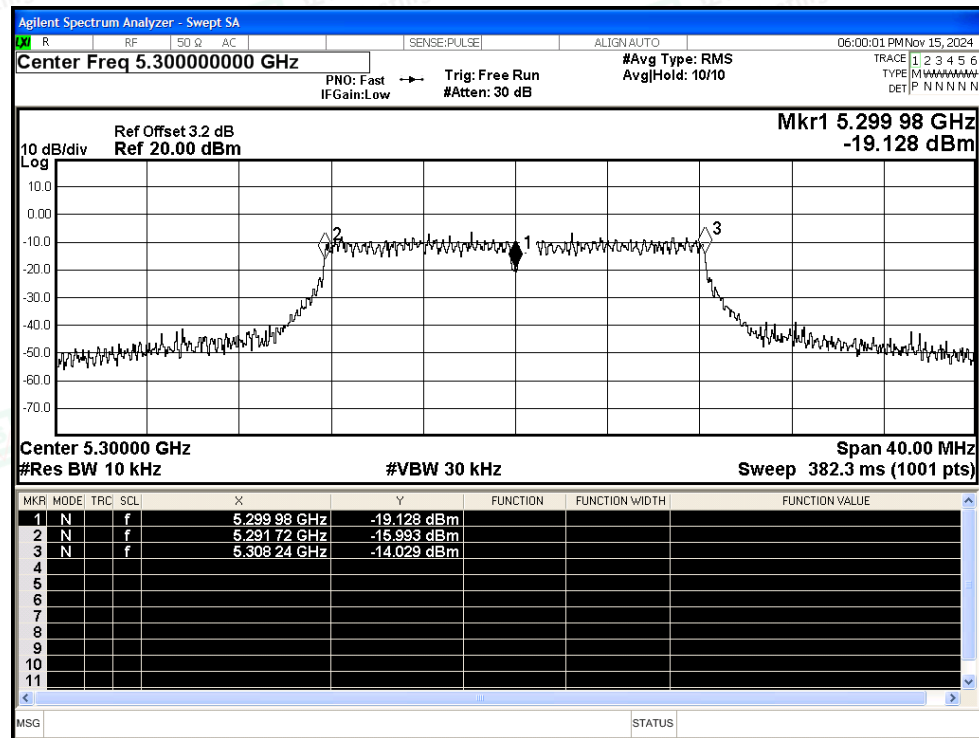

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant3

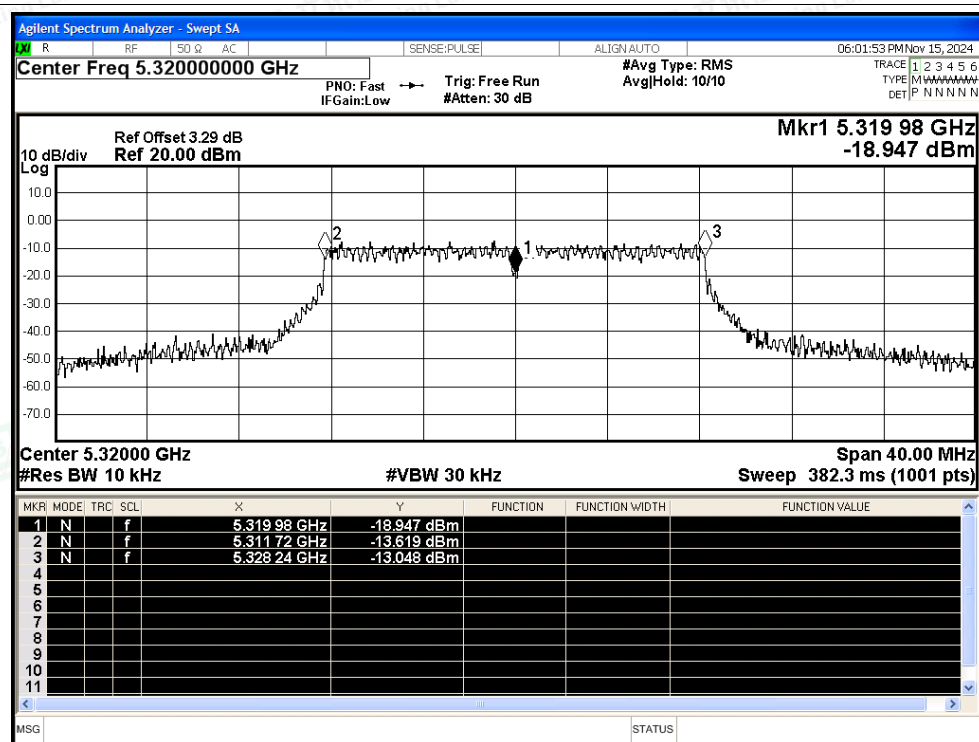

Freq. Stability NVNT n20 5260MHz Ant3

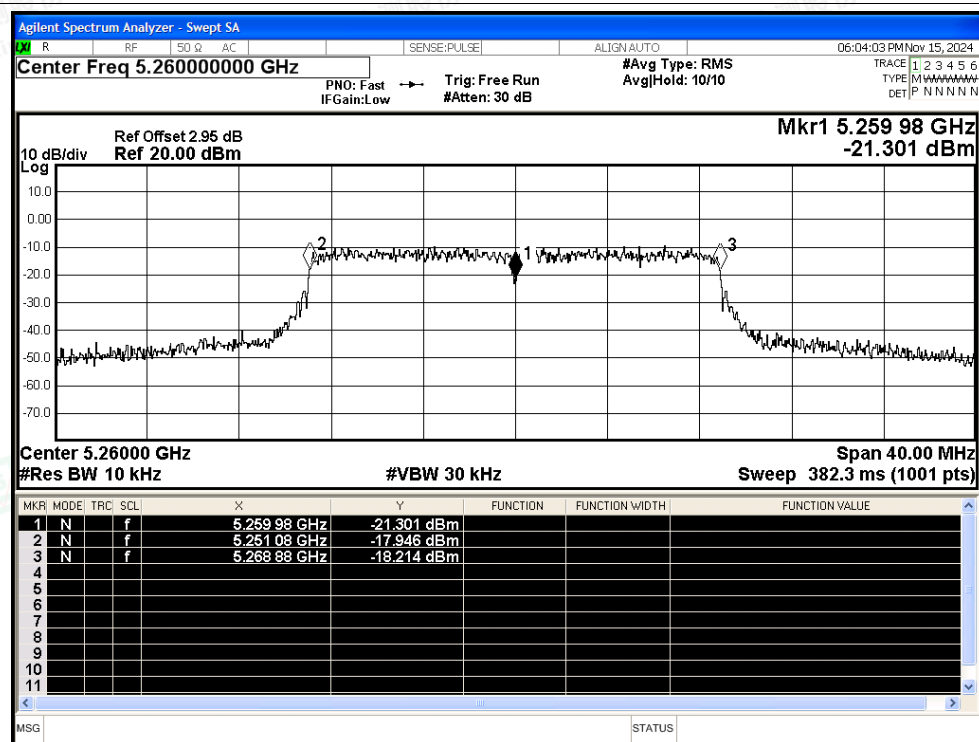

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant3

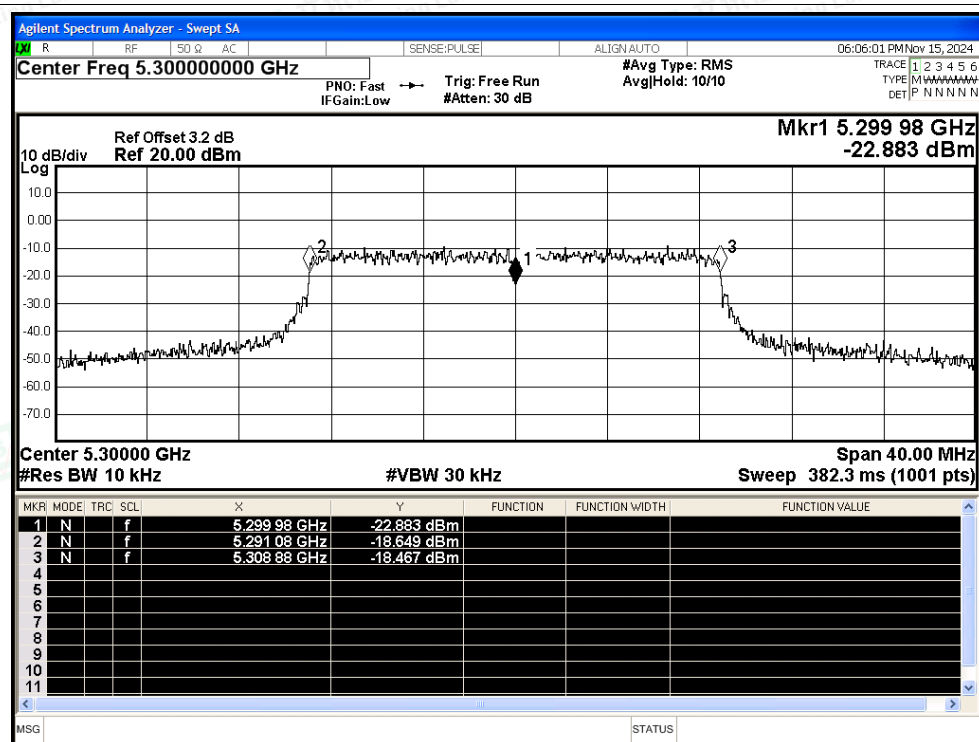

Freq. Stability NVNT n20 5320MHz Ant3

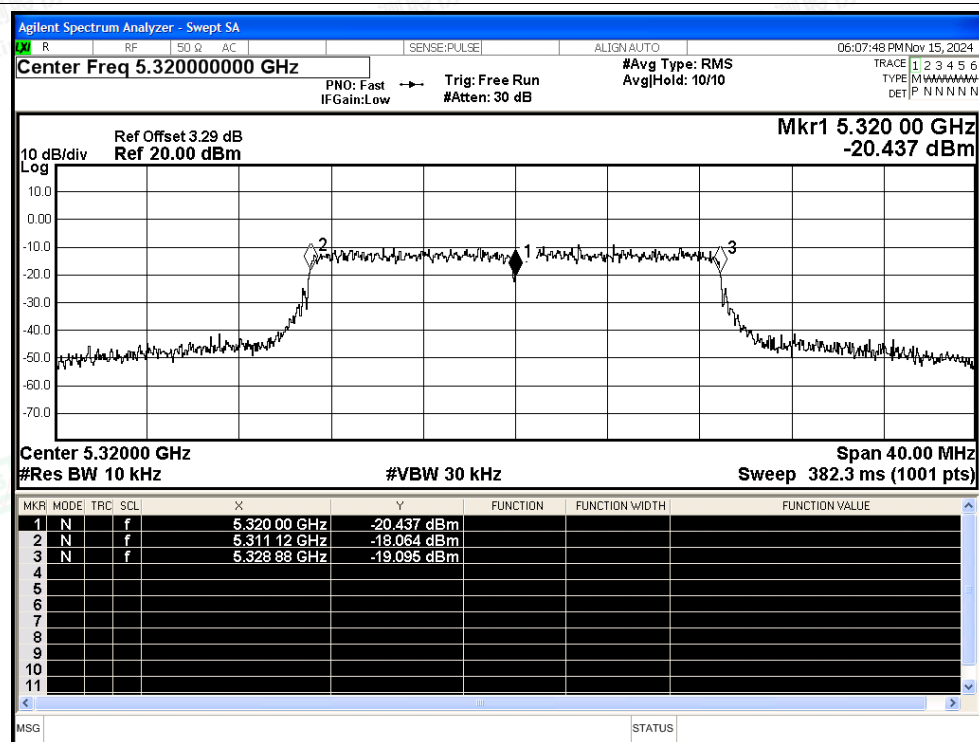

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant3

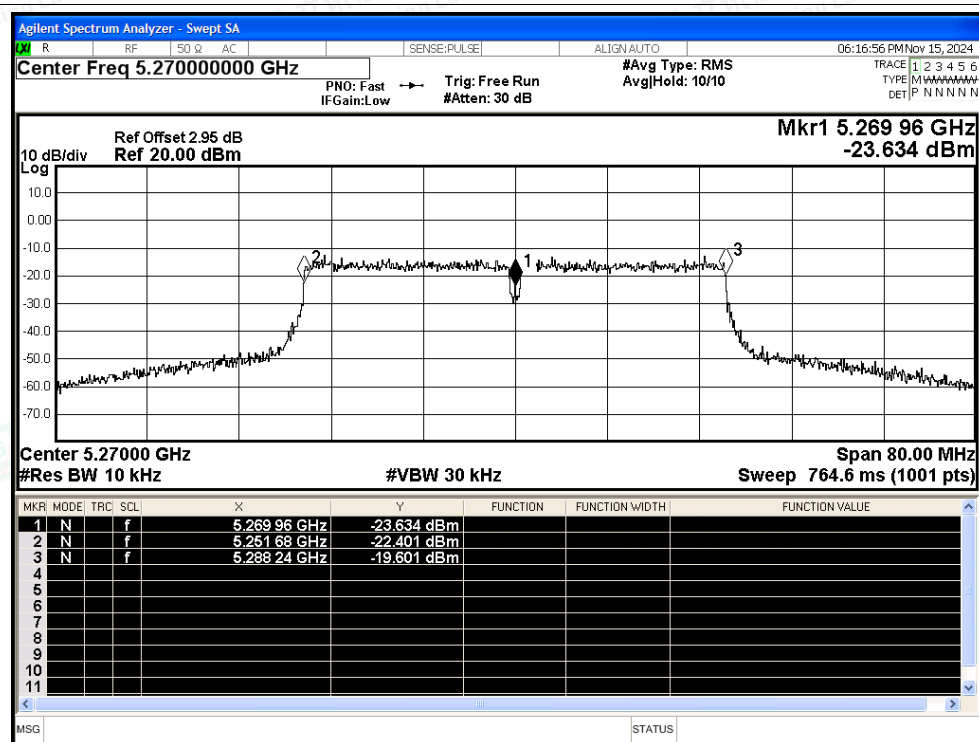

Freq. Stability NVNT n40 5310MHz Ant3

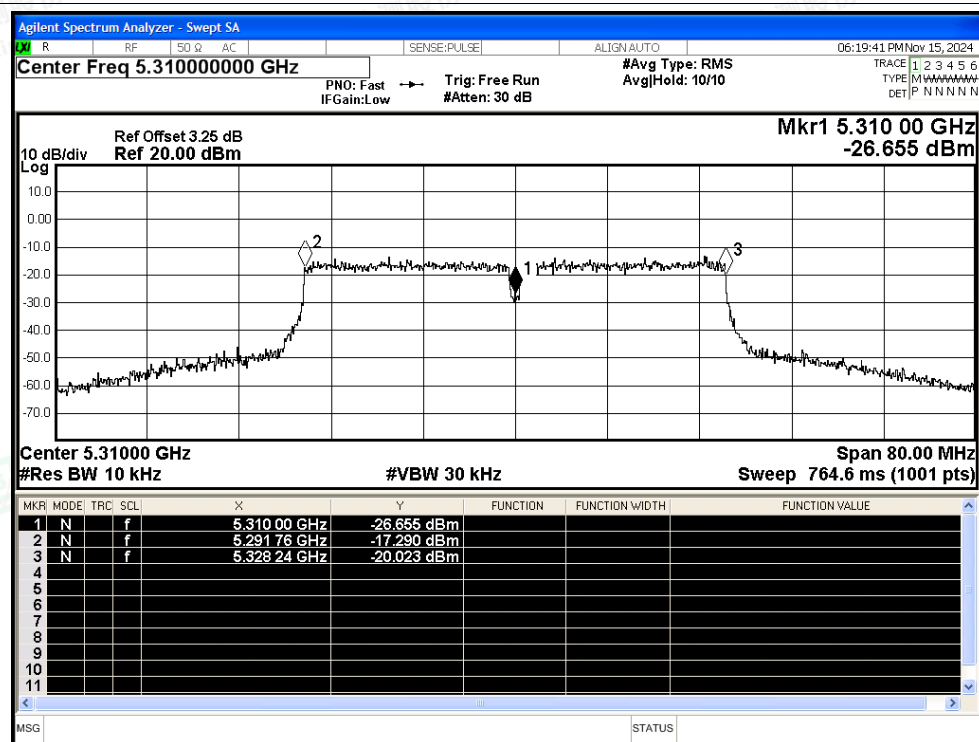

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant3

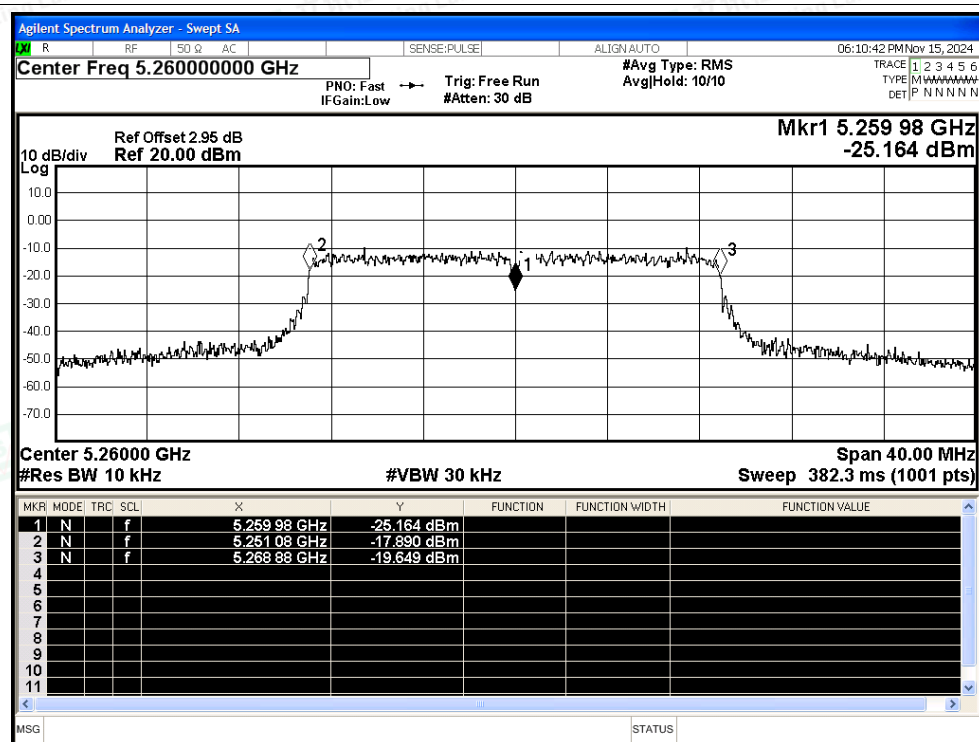

Freq. Stability NVNT ac20 5300MHz Ant3

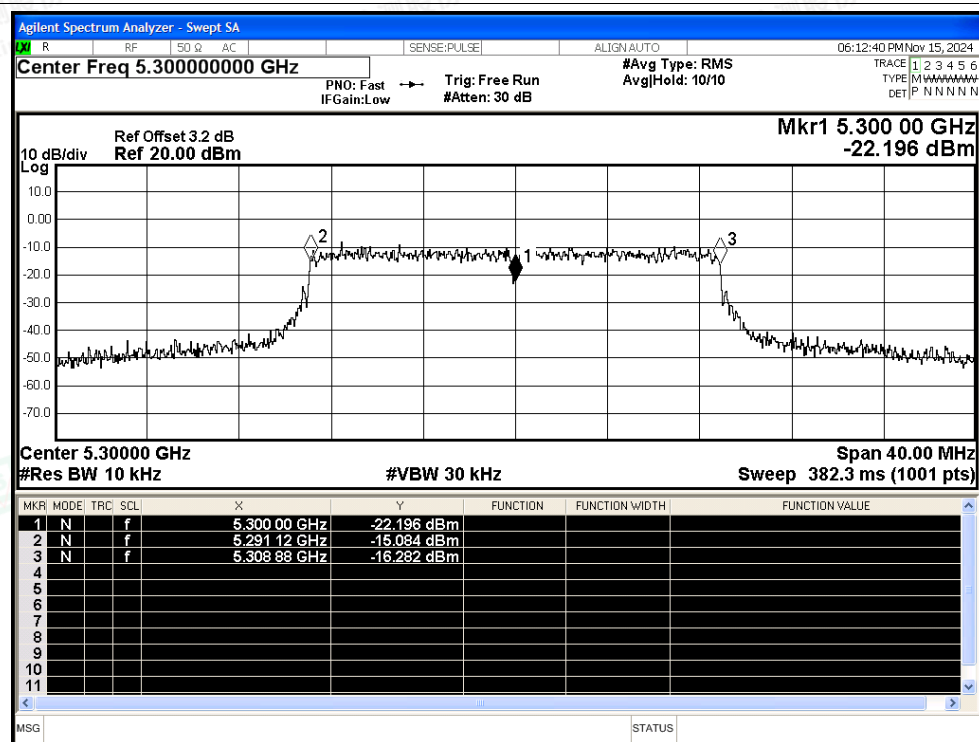

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant3

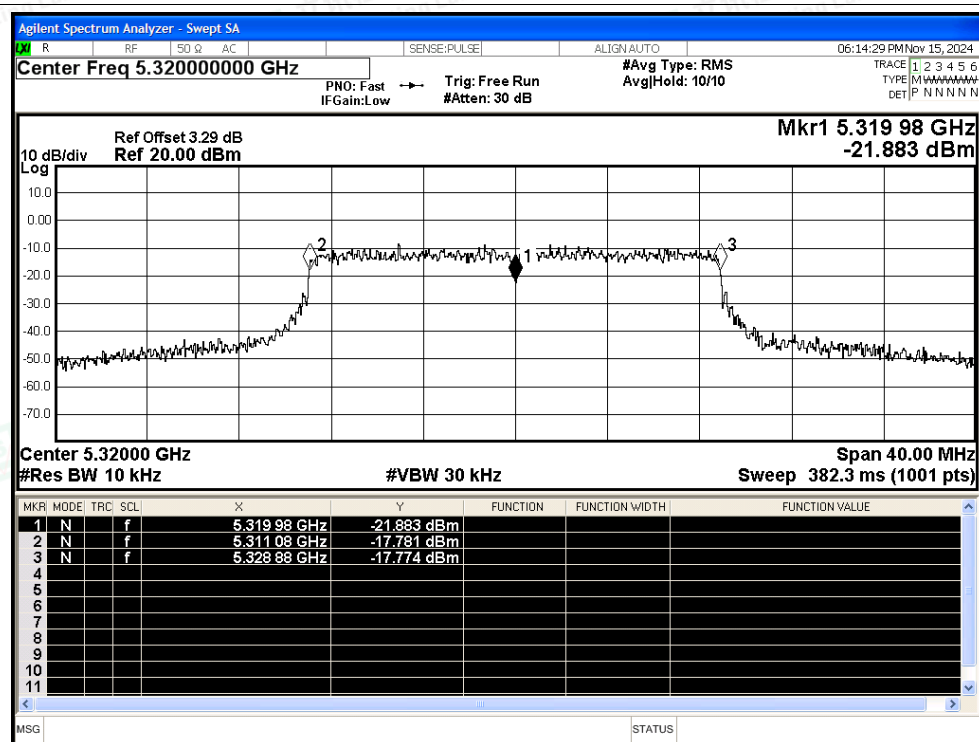

Freq. Stability NVNT ac40 5270MHz Ant3

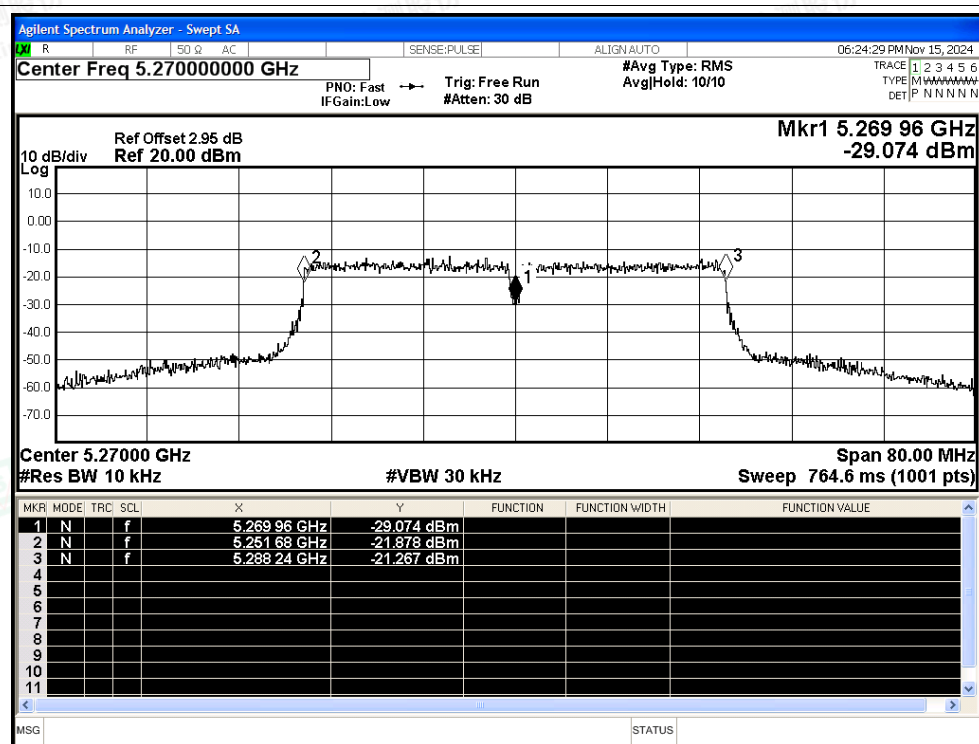

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant3

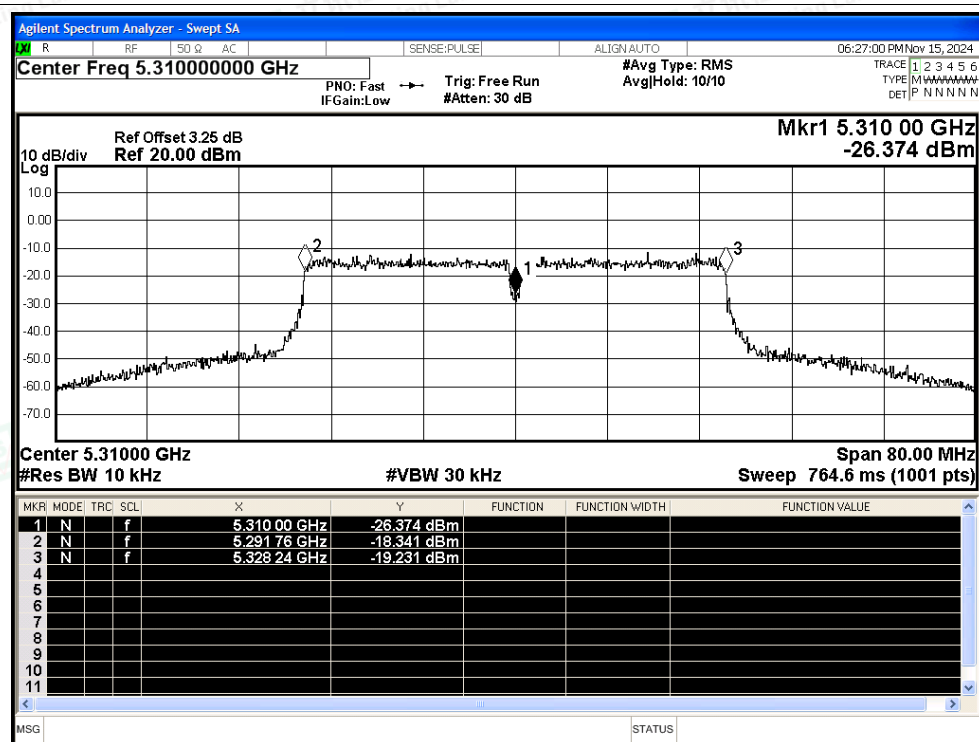

Freq. Stability NVNT ac80 5290MHz Ant3

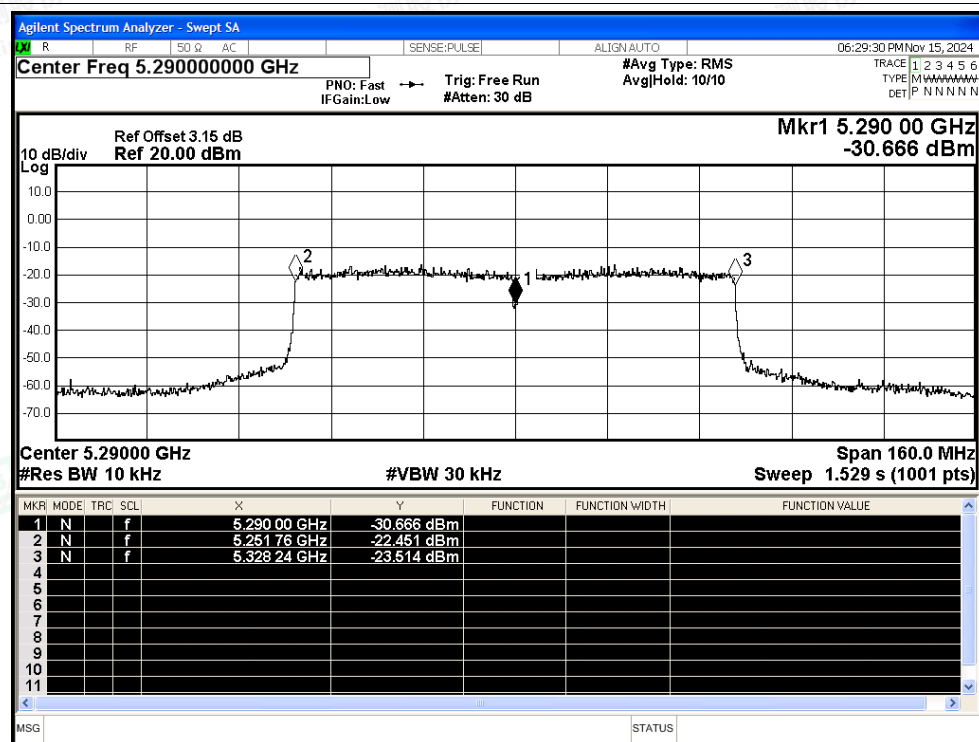

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant3

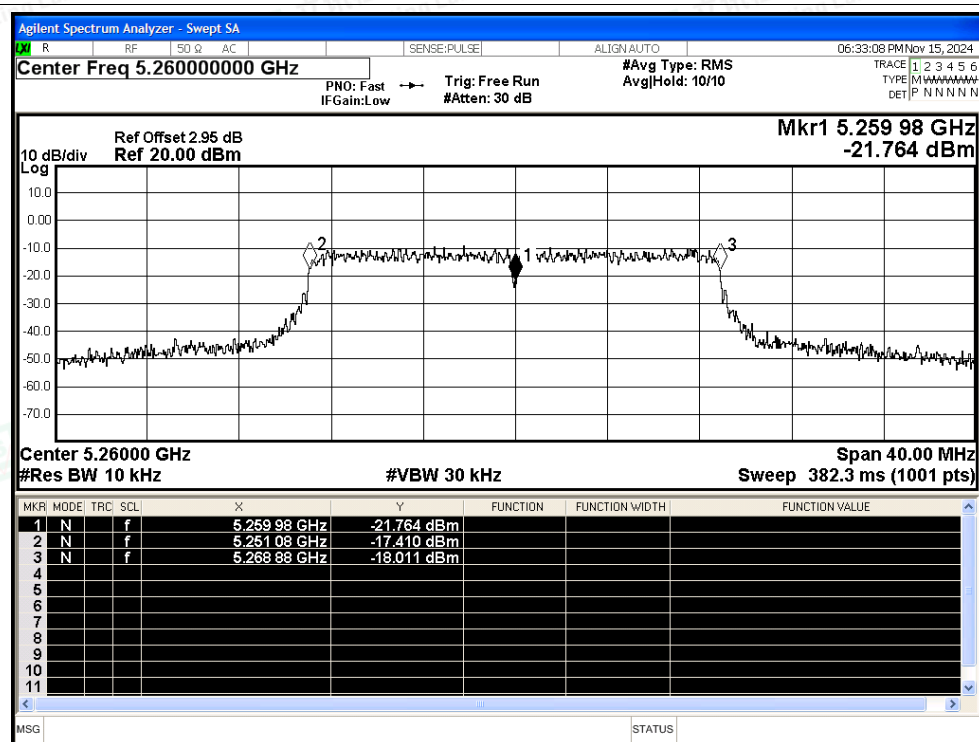

Freq. Stability NVNT ax20 5300MHz Ant3

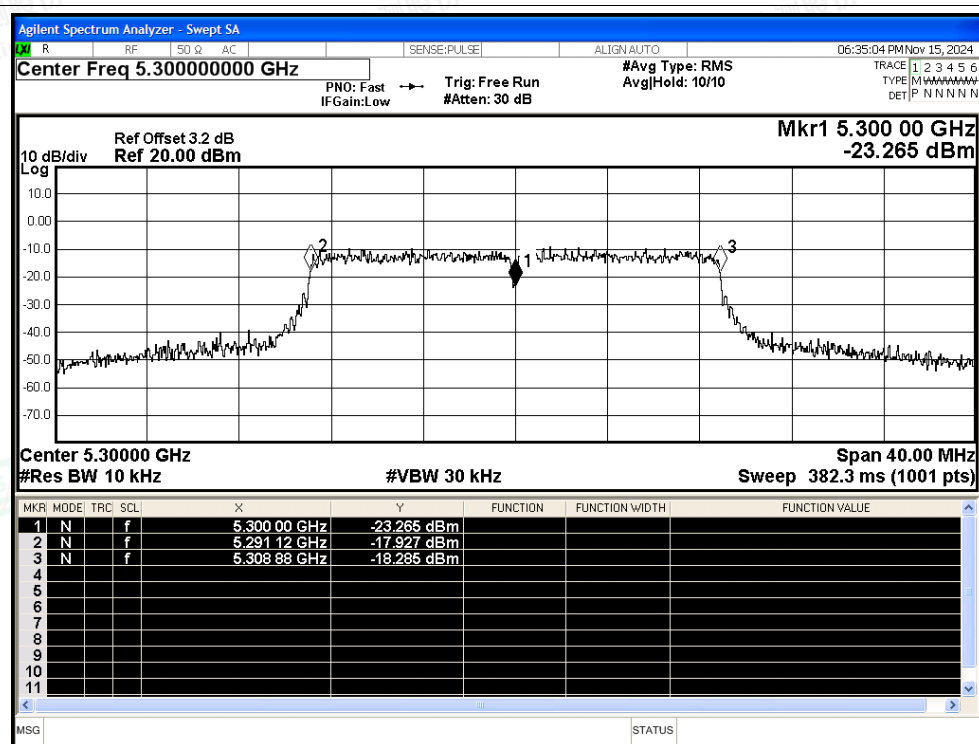

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant3

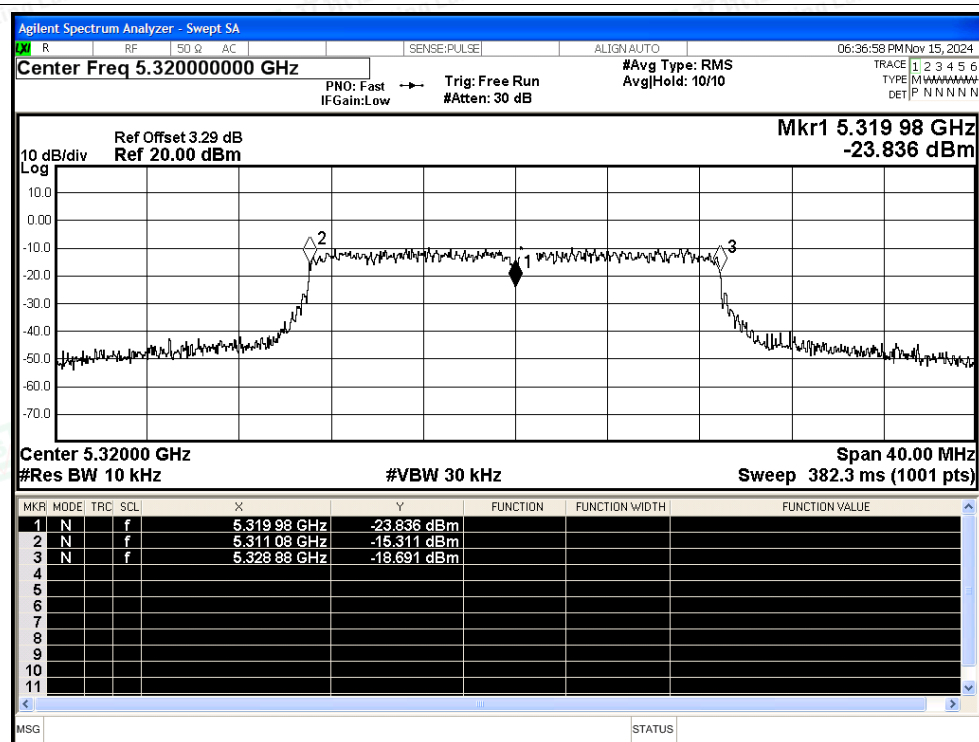

Freq. Stability NVNT ax40 5270MHz Ant3

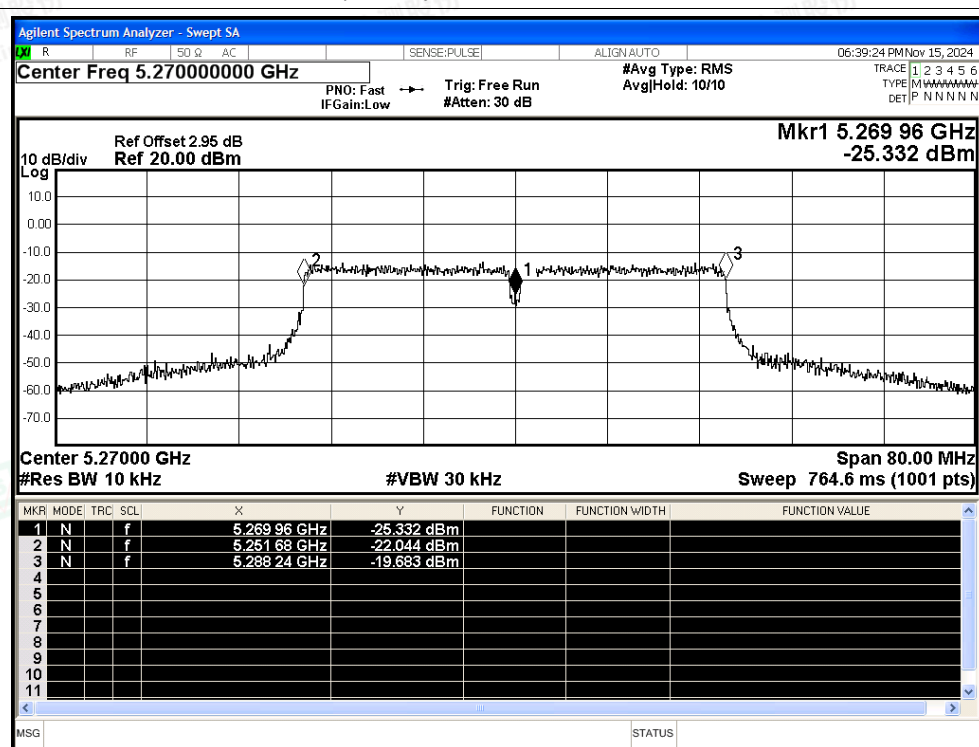

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant3

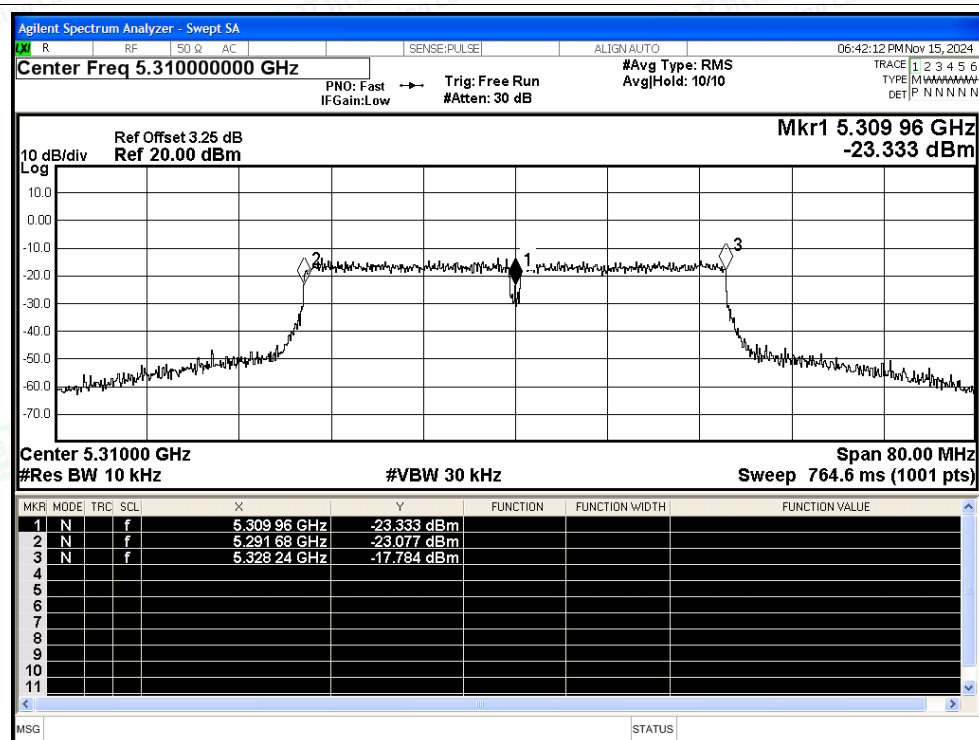


Freq. Stability NVNT ax80 5290MHz Ant3

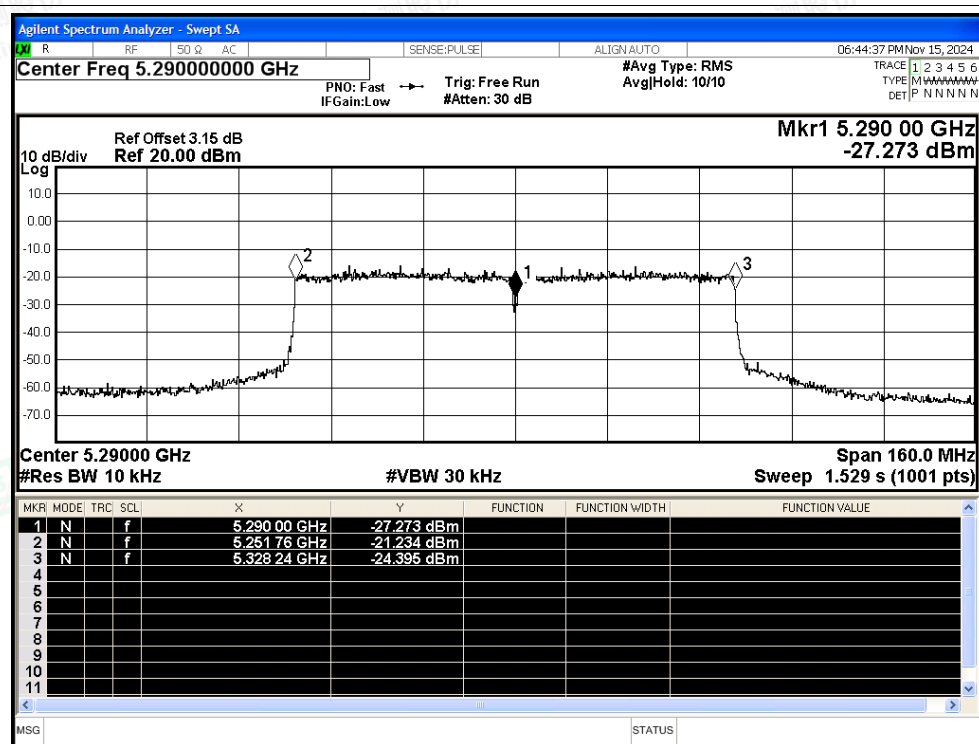




Freq. Stability NVNT ac160 5250MHz Ant3

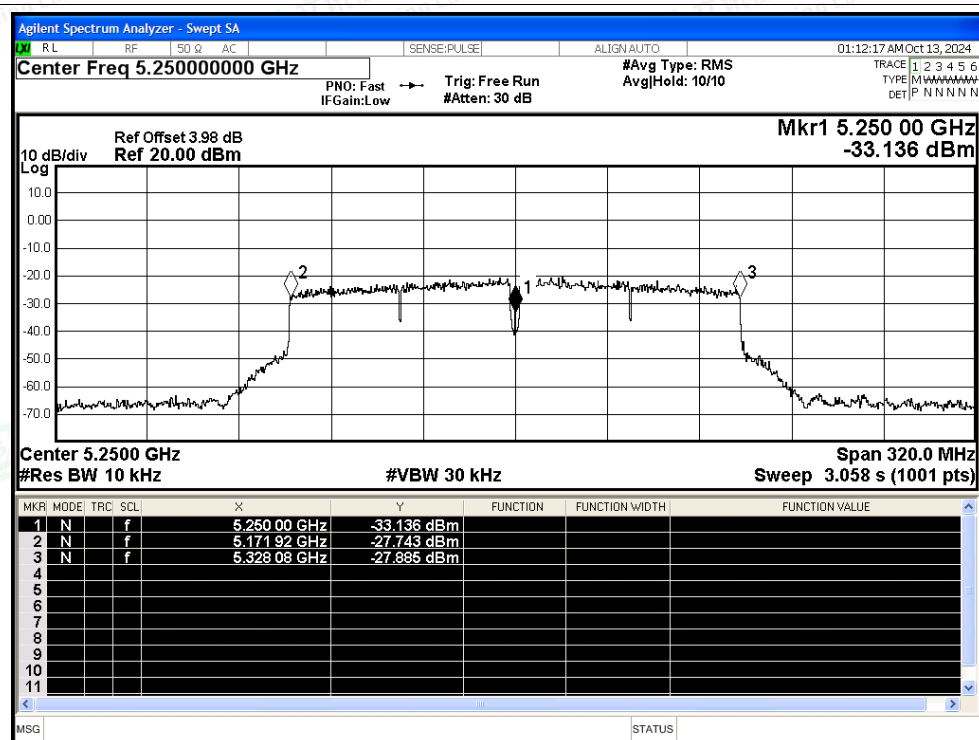

Freq. Stability NVNT ax160 5250MHz Ant3

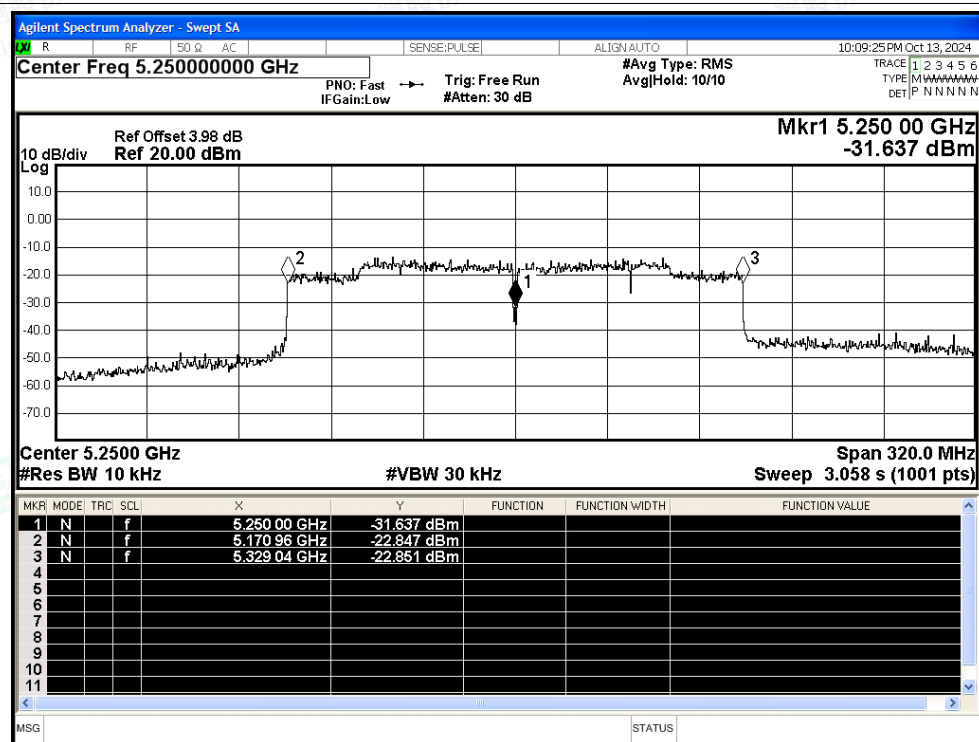




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant4	5259.98	-20000	-3.8	25	Pass
NVNT	a	5300	Ant4	5300	0	0	25	Pass
NVNT	a	5320	Ant4	5320	0	0	25	Pass
NVNT	n20	5260	Ant4	5259.96	-40000	-7.6	25	Pass
NVNT	n20	5300	Ant4	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant4	5320	0	0	25	Pass
NVNT	n40	5270	Ant4	5269.96	-40000	-7.59	25	Pass
NVNT	n40	5310	Ant4	5310	0	0	25	Pass
NVNT	ac20	5260	Ant4	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant4	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant4	5320	0	0	25	Pass
NVNT	ac40	5270	Ant4	5270	0	0	25	Pass
NVNT	ac40	5310	Ant4	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant4	5290	0	0	25	Pass
NVNT	ax20	5260	Ant4	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5300	Ant4	5300	0	0	25	Pass
NVNT	ax20	5320	Ant4	5319.96	-40000	-7.52	25	Pass
NVNT	ax40	5270	Ant4	5270	0	0	25	Pass
NVNT	ax40	5310	Ant4	5310	0	0	25	Pass
NVNT	ax80	5290	Ant4	5290	0	0	25	Pass
NVNT	ac160	5250	Ant4	5250	0	0	25	Pass
NVNT	ax160	5250	Ant4	5250	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5260MHz Ant4

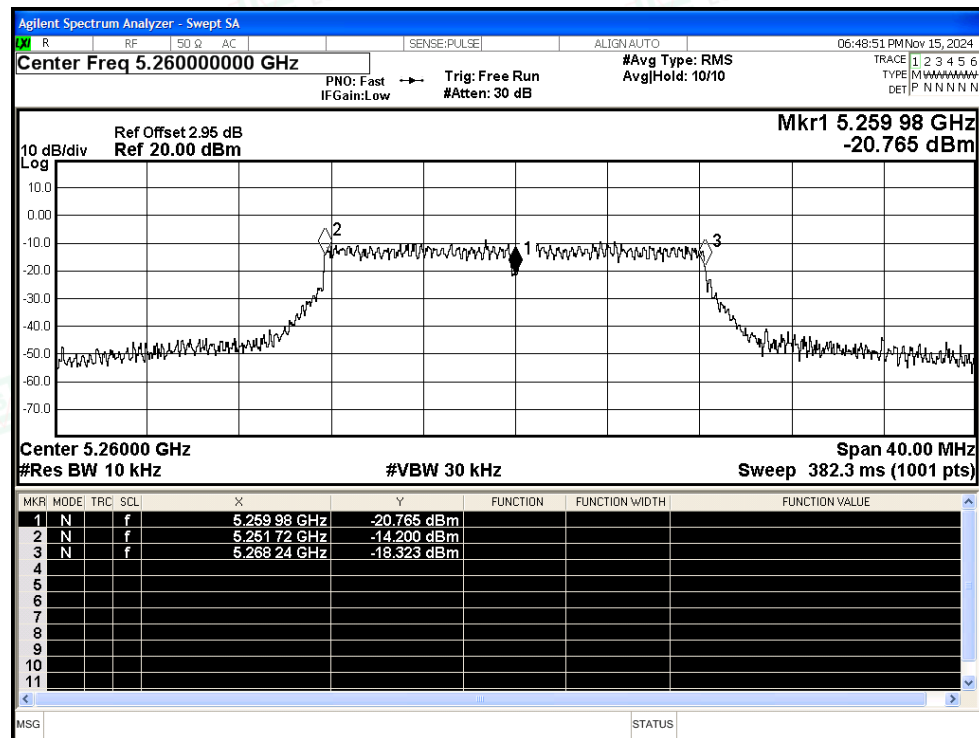

Freq. Stability NVNT a 5300MHz Ant4

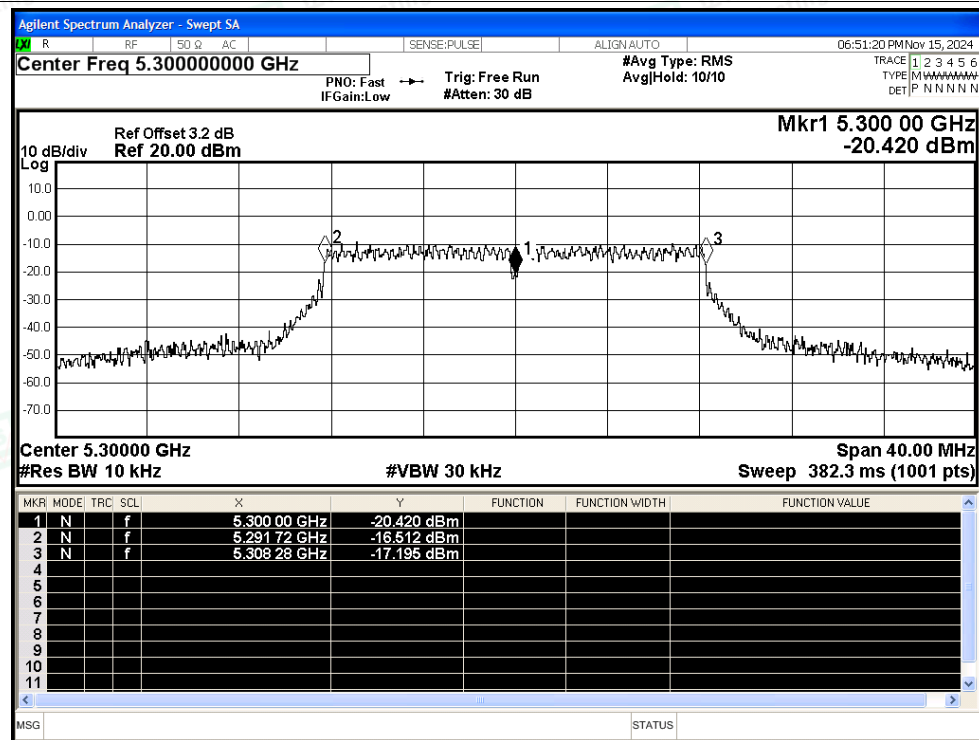

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant4

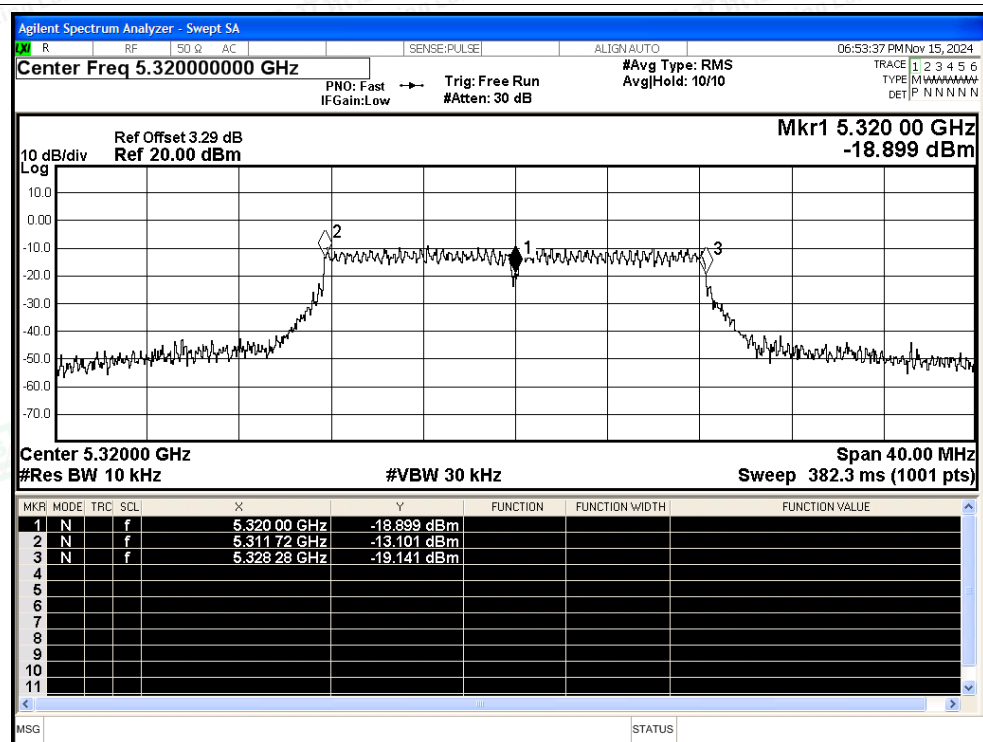


Freq. Stability NVNT n20 5260MHz Ant4

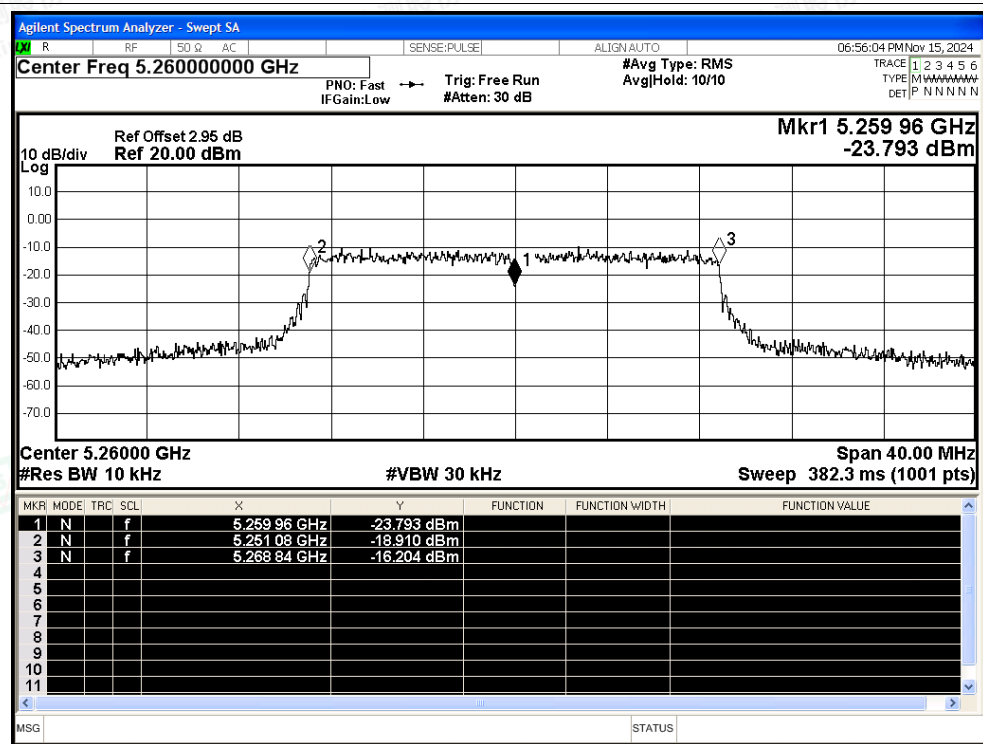




Freq. Stability NVNT n20 5300MHz Ant4

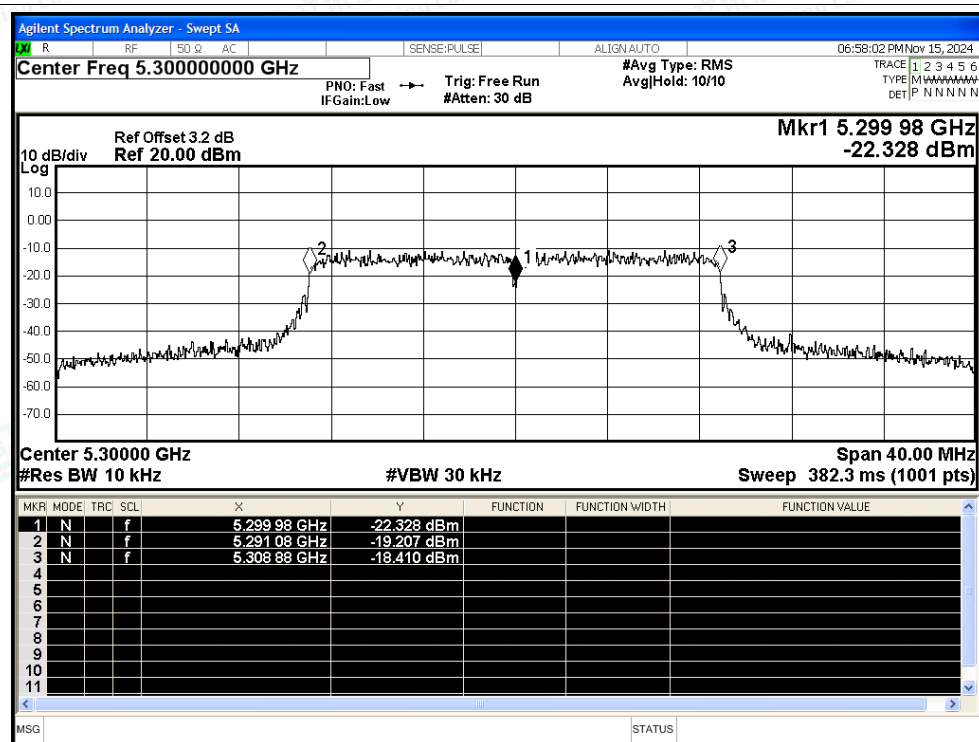

Freq. Stability NVNT n20 5320MHz Ant4

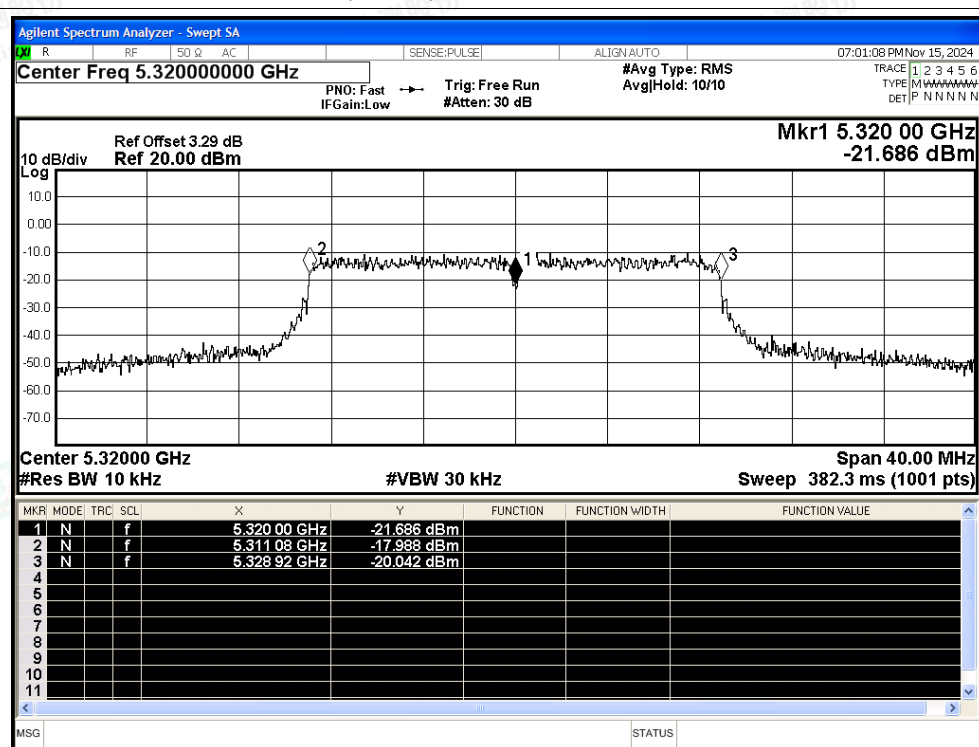

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant4

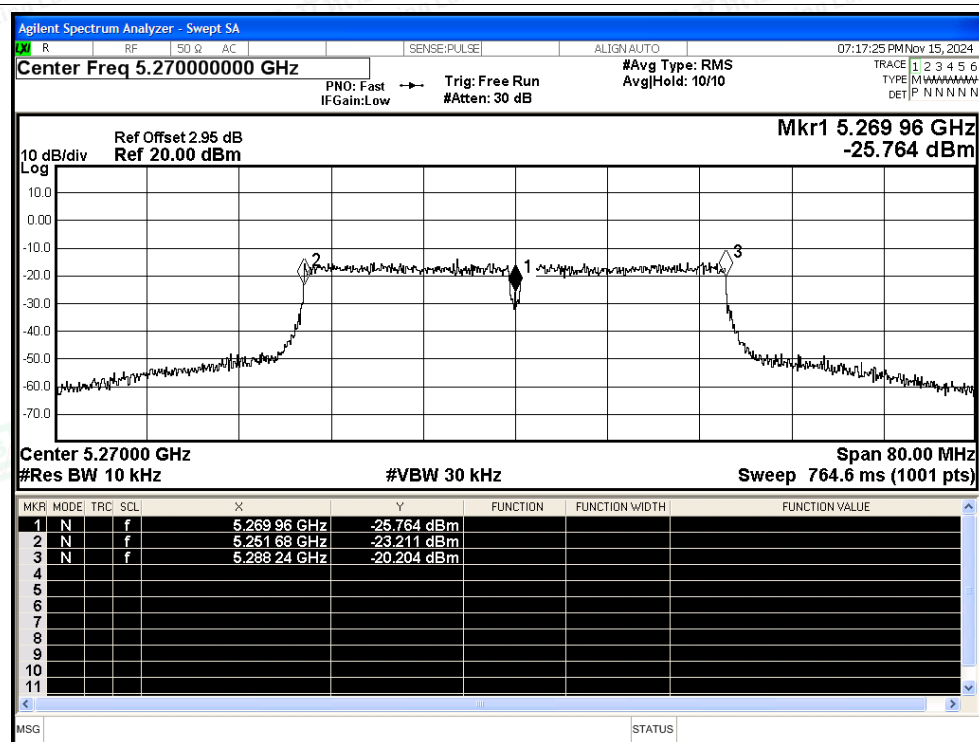

Freq. Stability NVNT n40 5310MHz Ant4

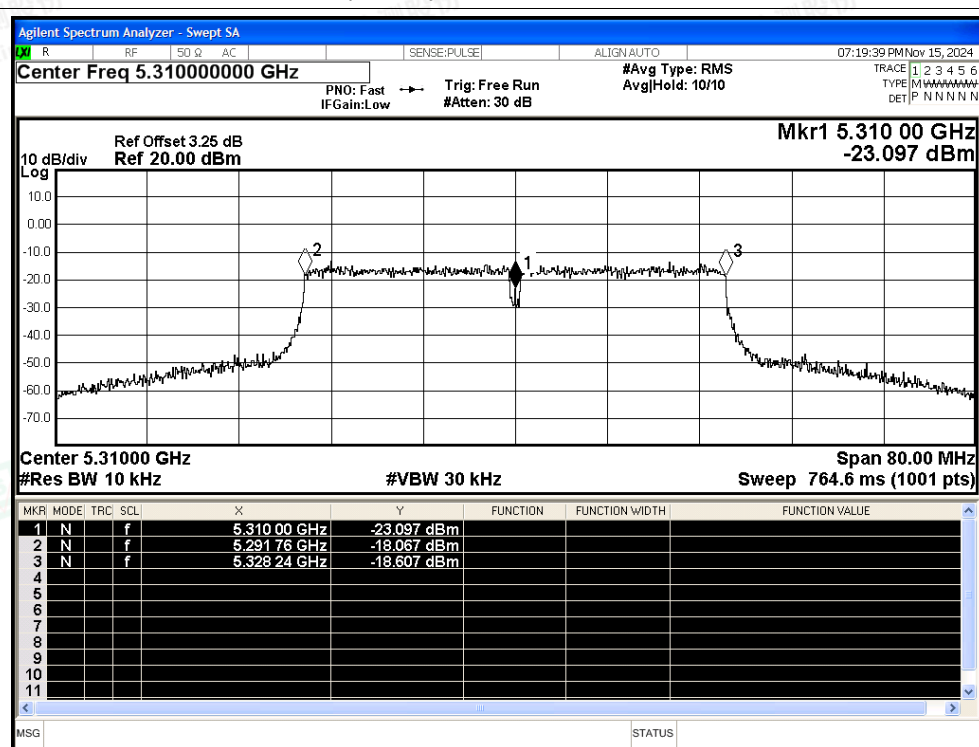

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant4

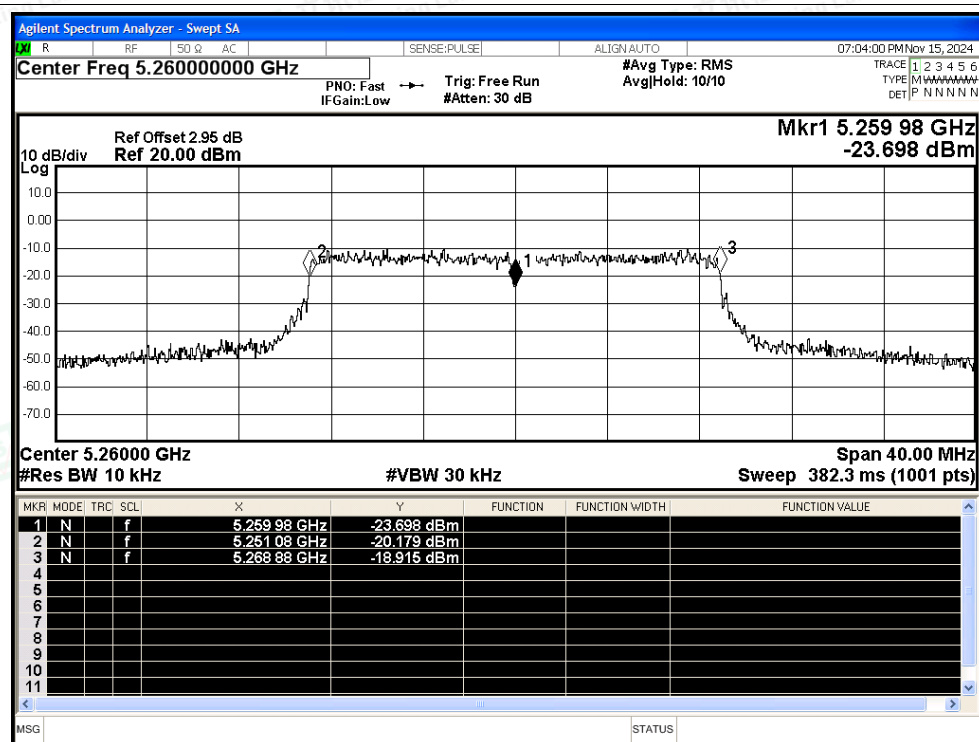

Freq. Stability NVNT ac20 5300MHz Ant4

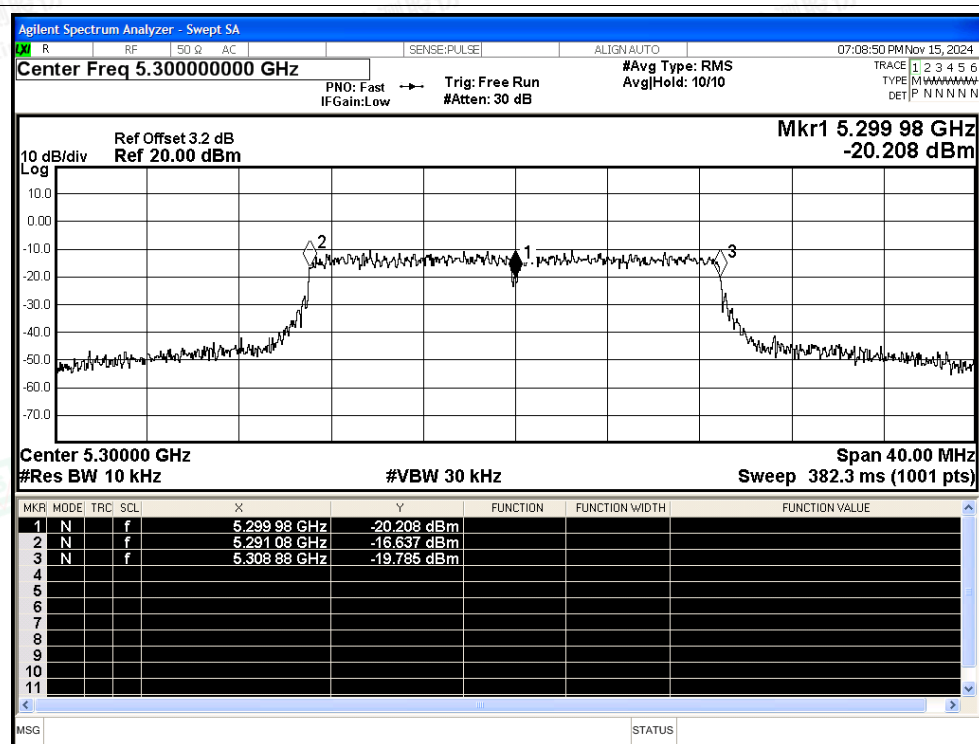

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant4

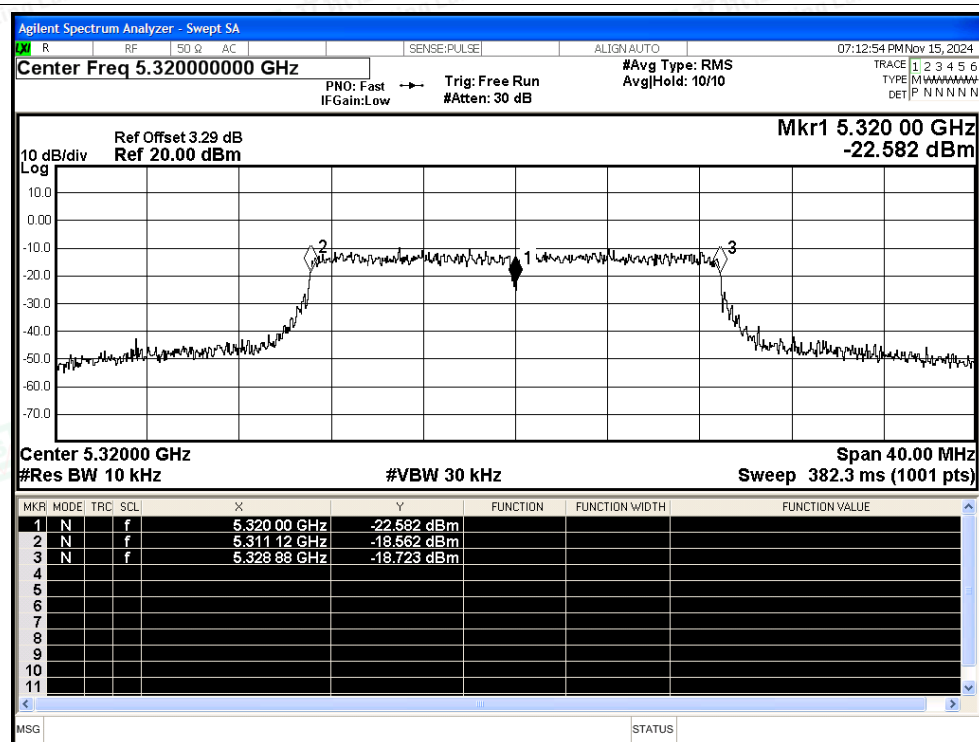

Freq. Stability NVNT ac40 5270MHz Ant4

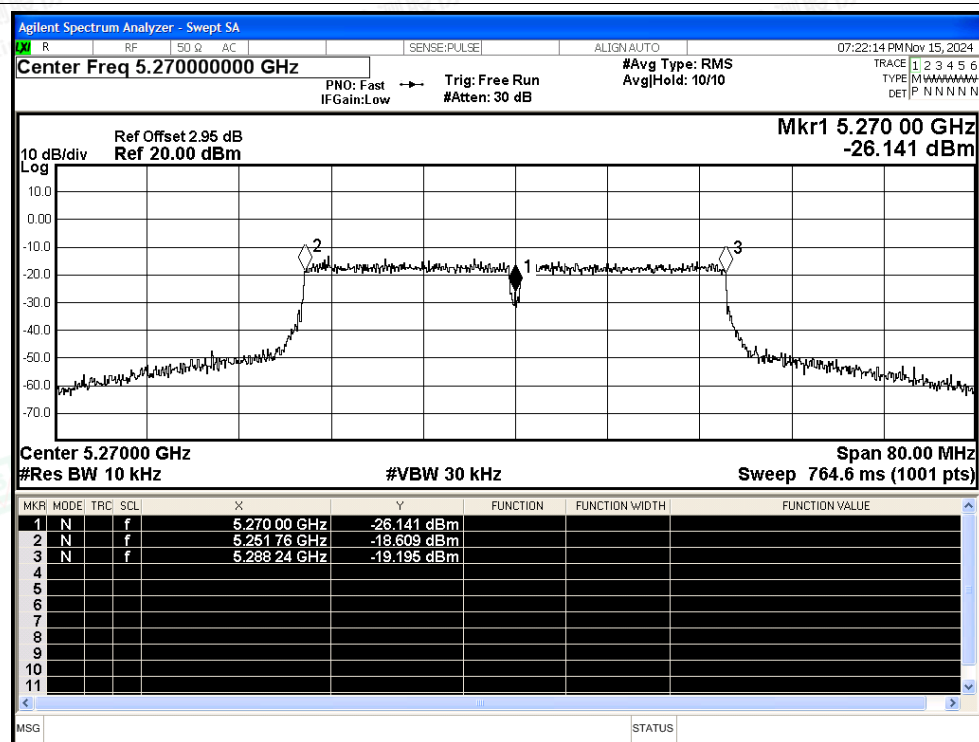

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant4

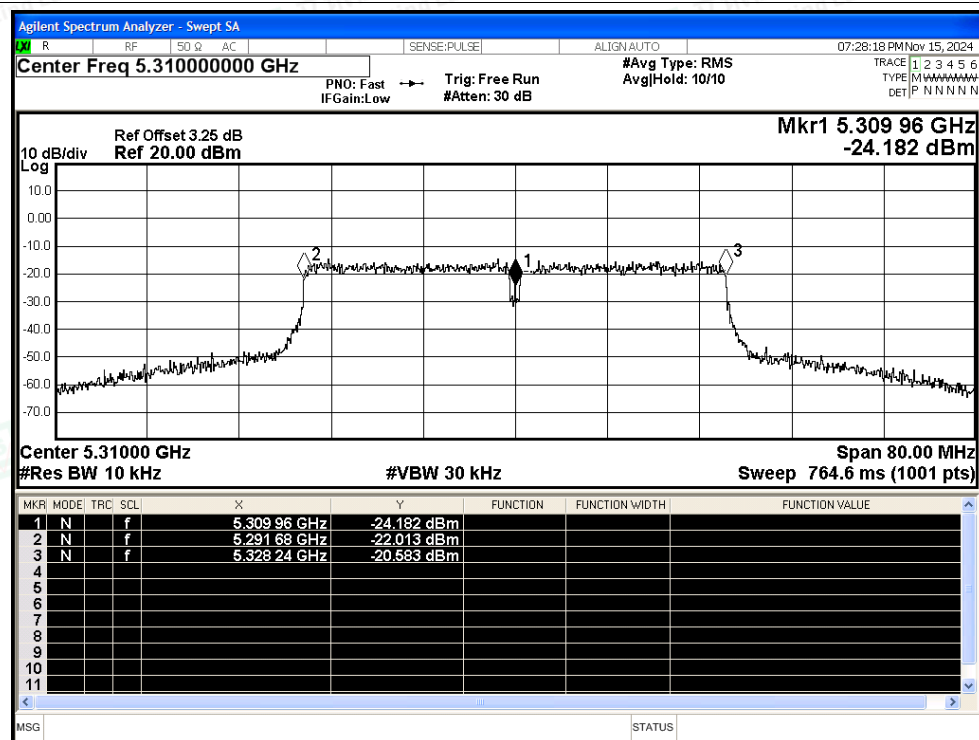

Freq. Stability NVNT ac80 5290MHz Ant4

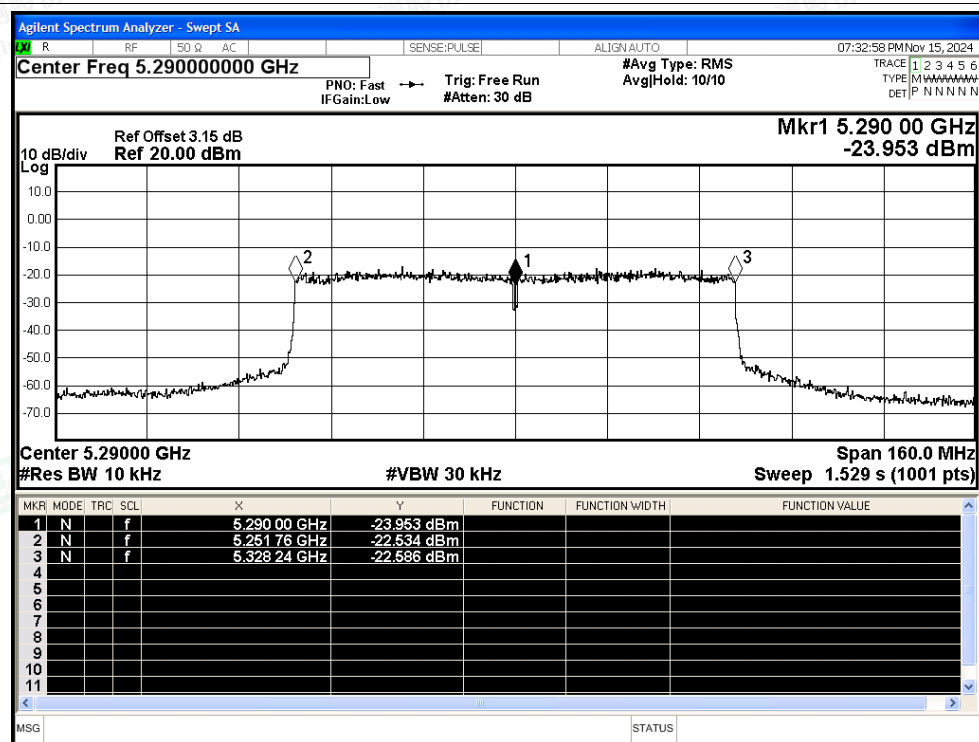

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant4

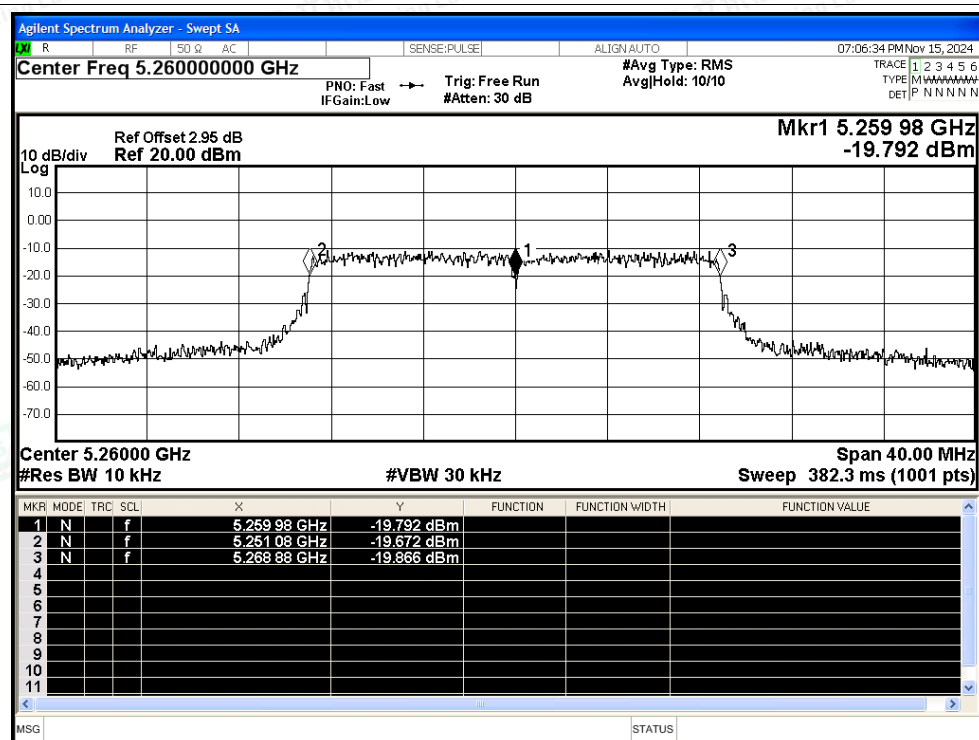

Freq. Stability NVNT ax20 5300MHz Ant4

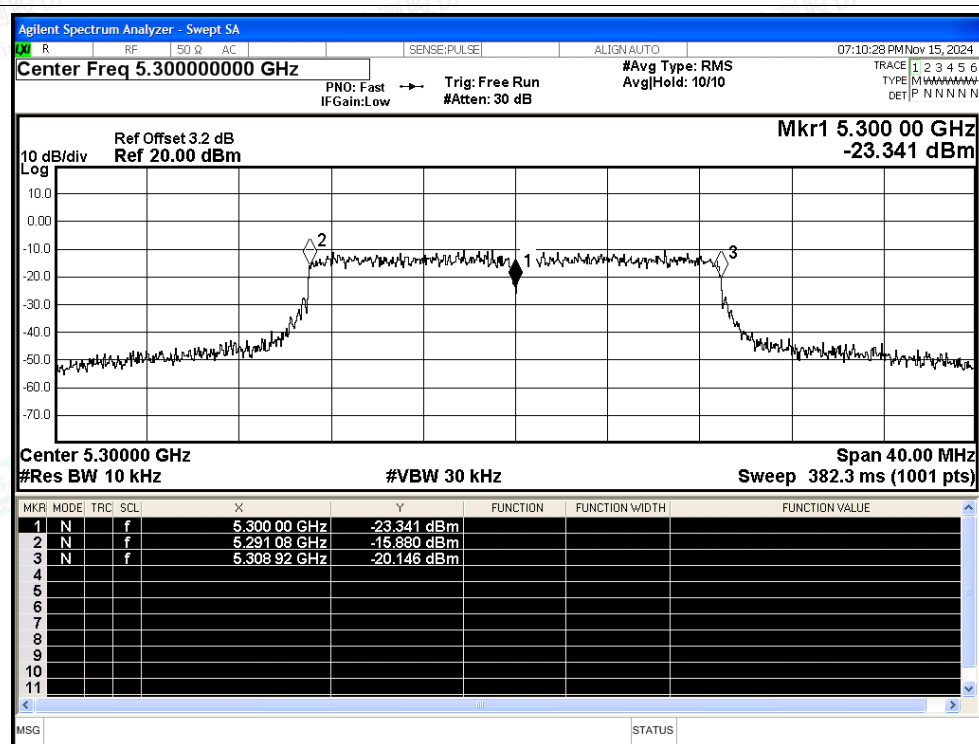

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant4

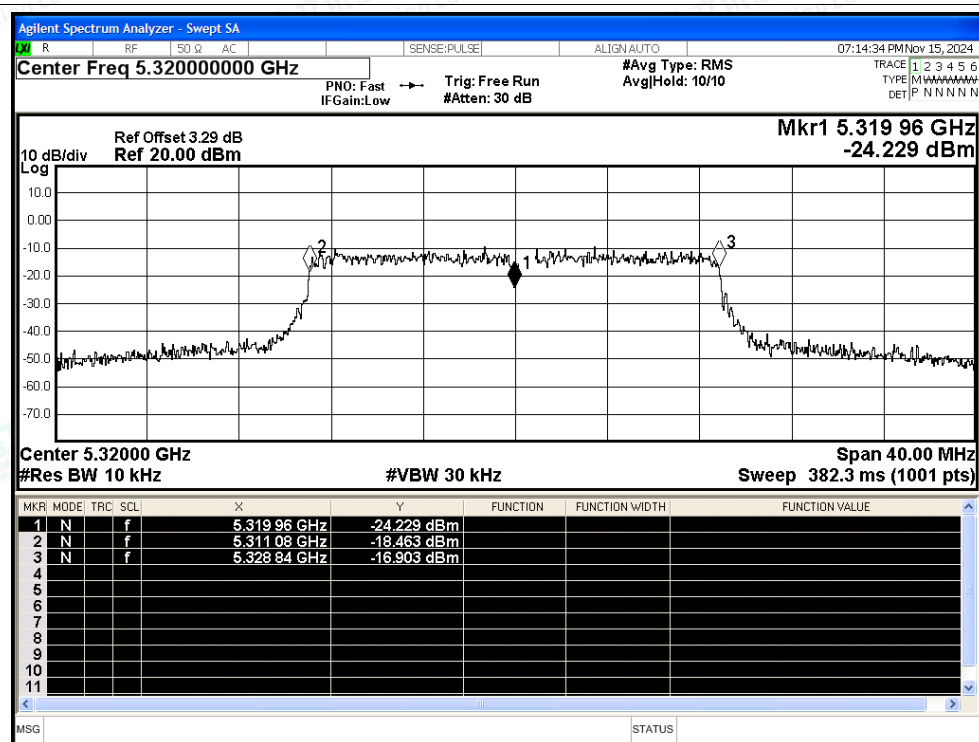

Freq. Stability NVNT ax40 5270MHz Ant4

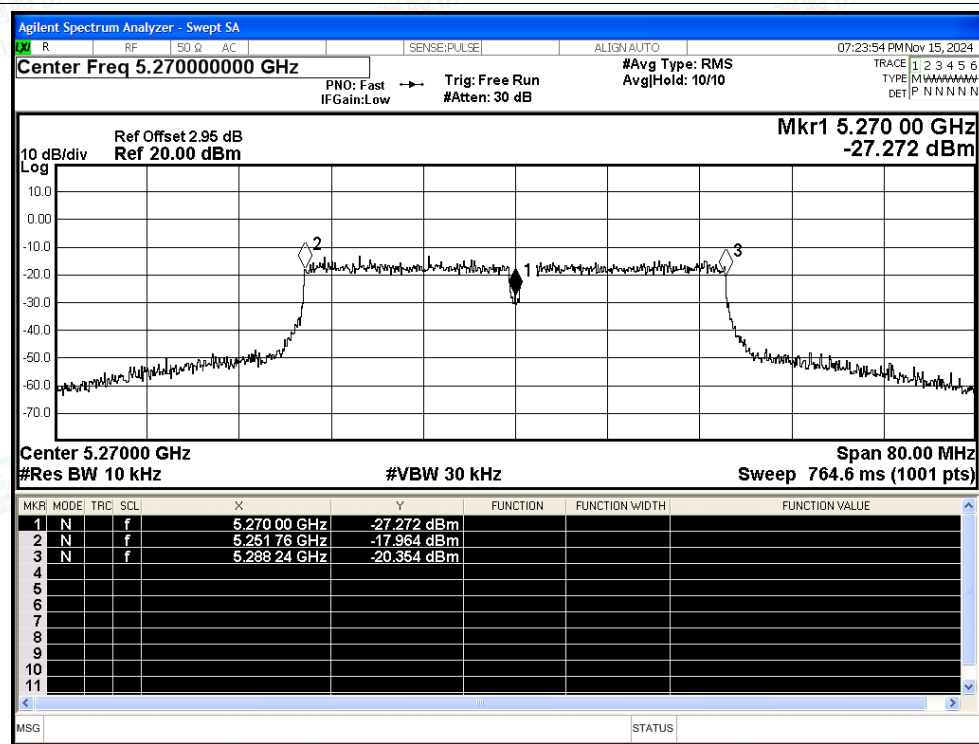

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant4

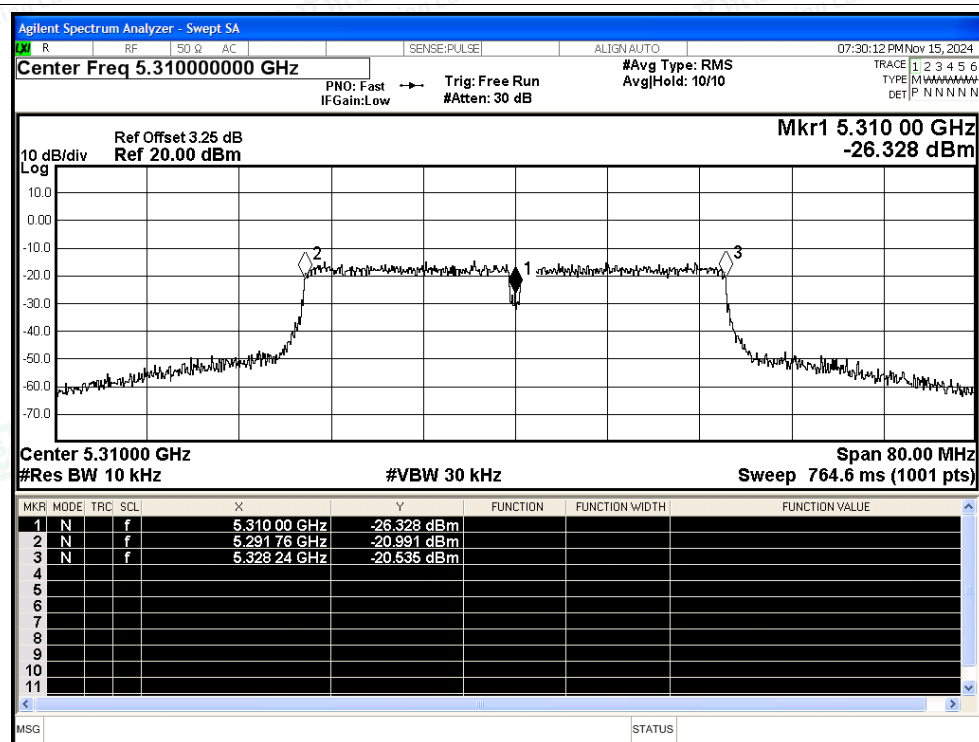

Freq. Stability NVNT ax80 5290MHz Ant4

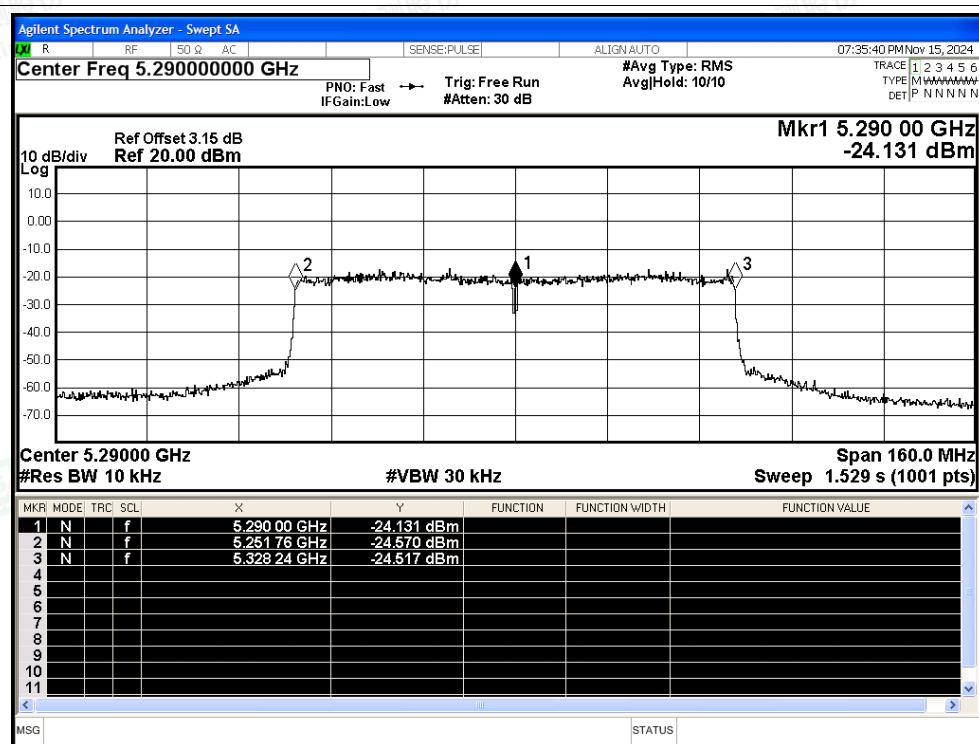

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac160 5250MHz Ant4

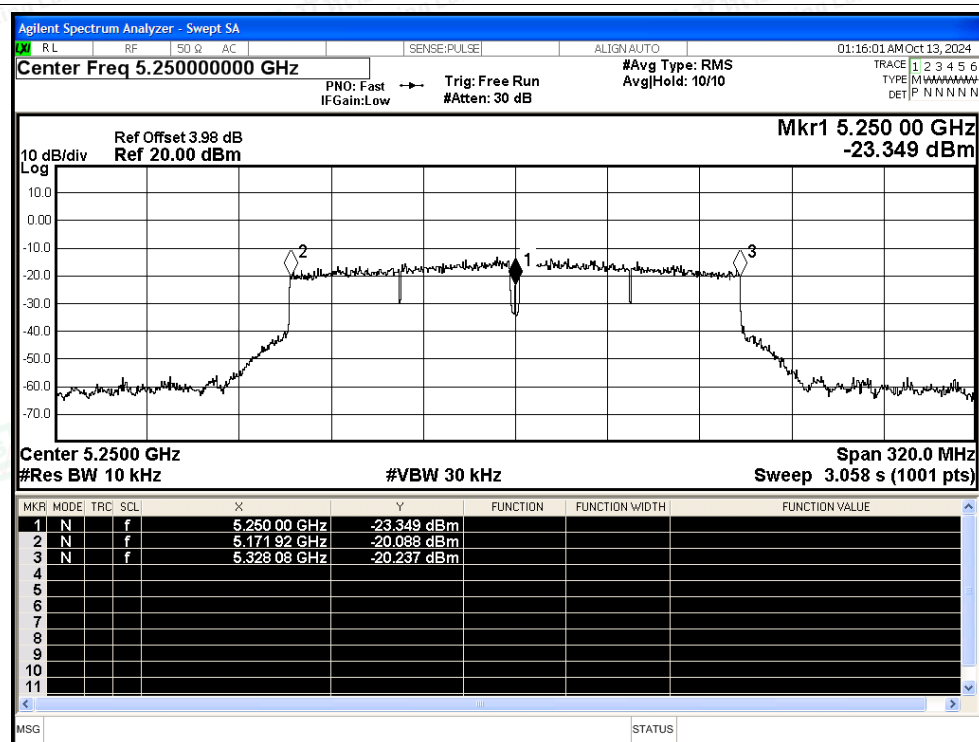

Freq. Stability NVNT ax160 5250MHz Ant4

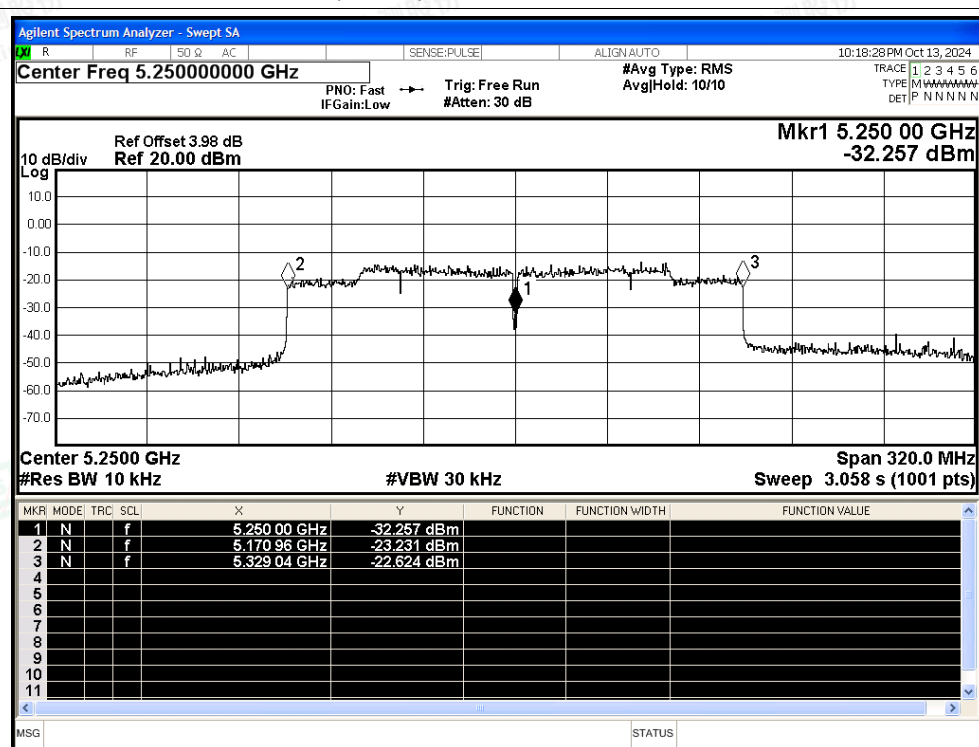

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



C.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant3	94.56	0.24	0.91
NVNT	a	5300	Ant3	94.56	0.24	0.91
NVNT	a	5320	Ant3	94.56	0.24	0.91
NVNT	n20	5260	Ant3	97.29	0.12	0.44
NVNT	n20	5300	Ant3	97.29	0.12	0.44
NVNT	n20	5320	Ant3	97.29	0.12	0.44
NVNT	n40	5270	Ant3	97.23	0.12	0.46
NVNT	n40	5310	Ant3	97.23	0.12	0.46
NVNT	ac20	5260	Ant3	97.3	0.12	0.44
NVNT	ac20	5300	Ant3	97.34	0.12	0.44
NVNT	ac20	5320	Ant3	97.34	0.12	0.44
NVNT	ac40	5270	Ant3	97.23	0.12	0.46
NVNT	ac40	5310	Ant3	97.23	0.12	0.46
NVNT	ac80	5290	Ant3	94.32	0.25	0.97
NVNT	ax20	5260	Ant3	97.34	0.12	0.44
NVNT	ax20	5300	Ant3	97.3	0.12	0.44
NVNT	ax20	5320	Ant3	97.34	0.12	0.44
NVNT	ax40	5270	Ant3	97.24	0.12	0.46
NVNT	ax40	5310	Ant3	97.19	0.12	0.46
NVNT	ax80	5290	Ant3	94.32	0.25	0.97
NVNT	ac160	5250	Ant3	94.44	0.25	1.03
NVNT	ax160	5250	Ant3	86.63	0.62	3.22






Test Graphs

Duty Cycle NVNT a 5260MHz Ant3

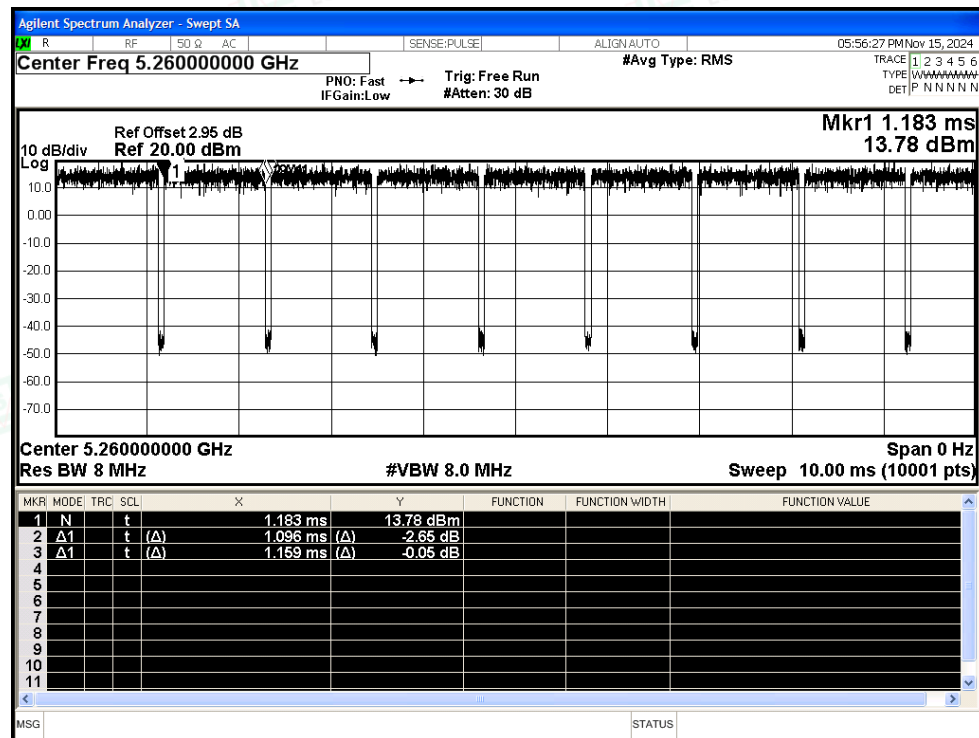

Duty Cycle NVNT a 5300MHz Ant3

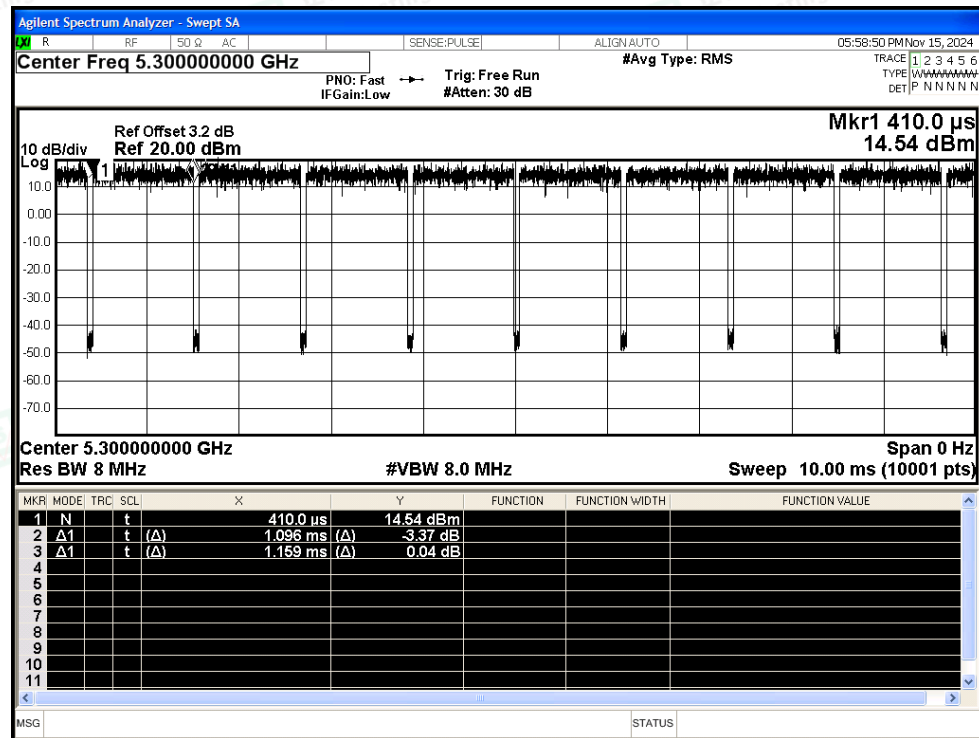

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant3

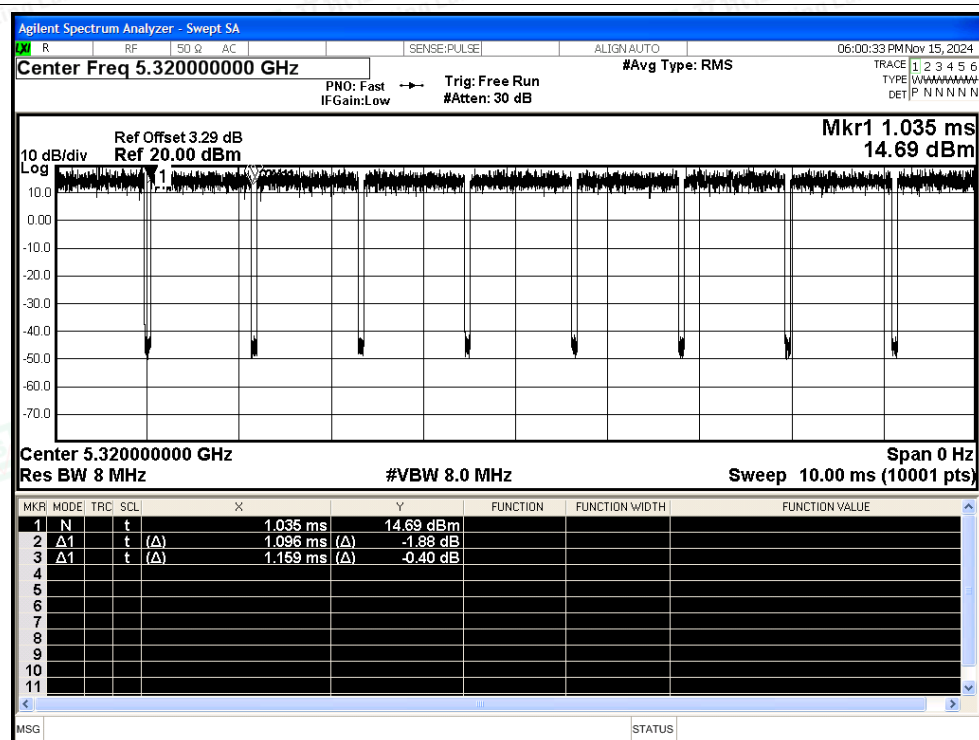


Duty Cycle NVNT n20 5260MHz Ant3

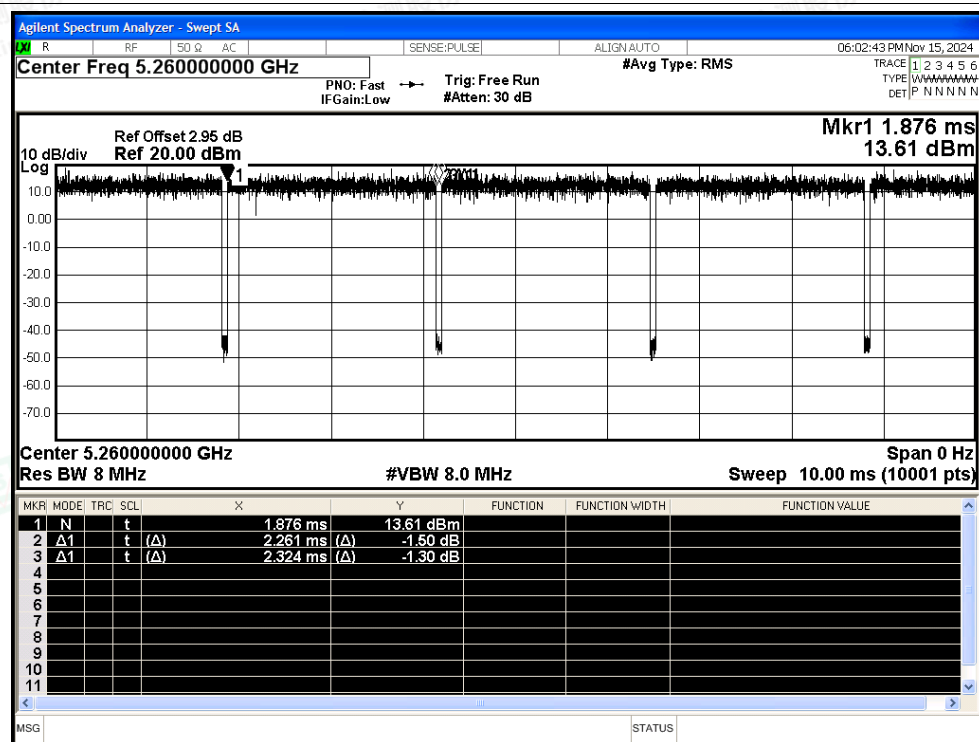




Duty Cycle NVNT n20 5300MHz Ant3

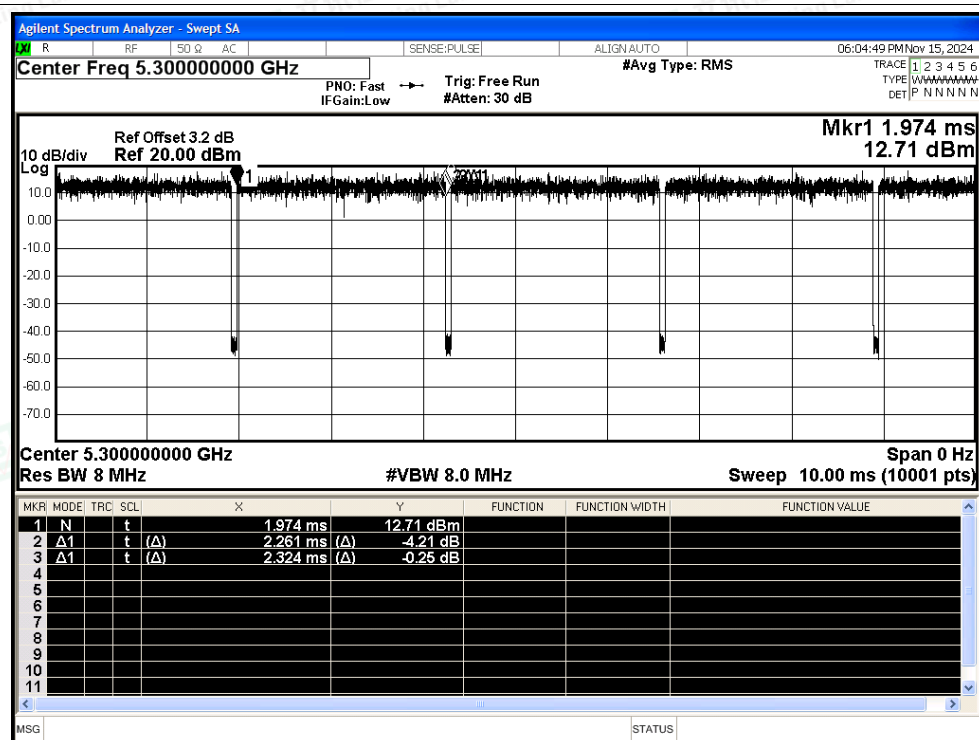


Duty Cycle NVNT n20 5320MHz Ant3

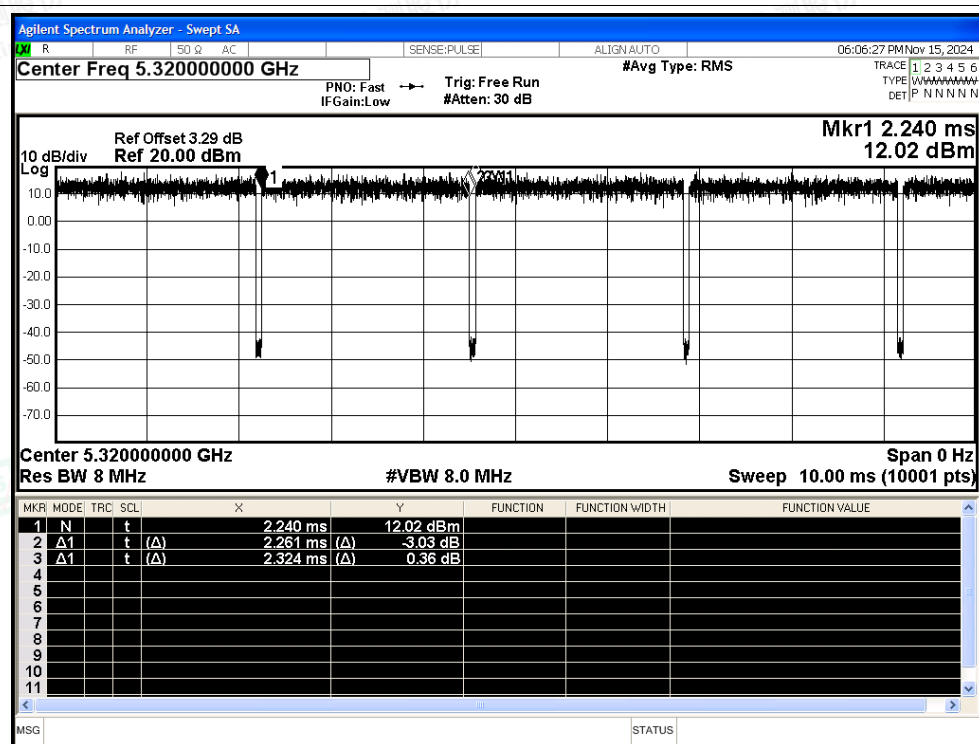




Duty Cycle NVNT n40 5270MHz Ant3

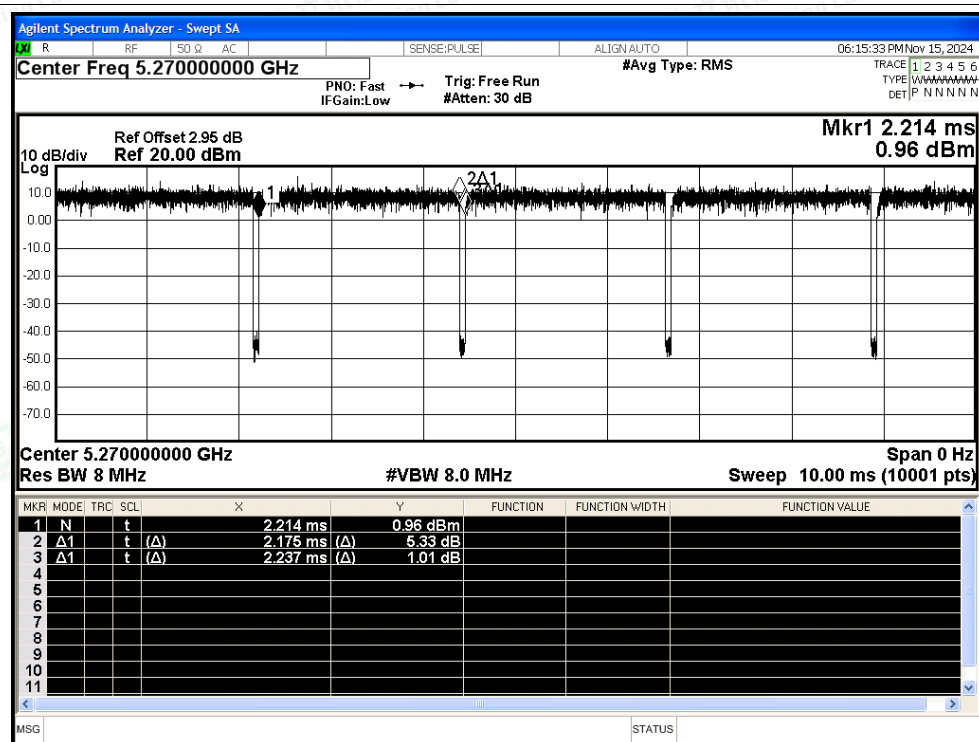


Duty Cycle NVNT n40 5310MHz Ant3

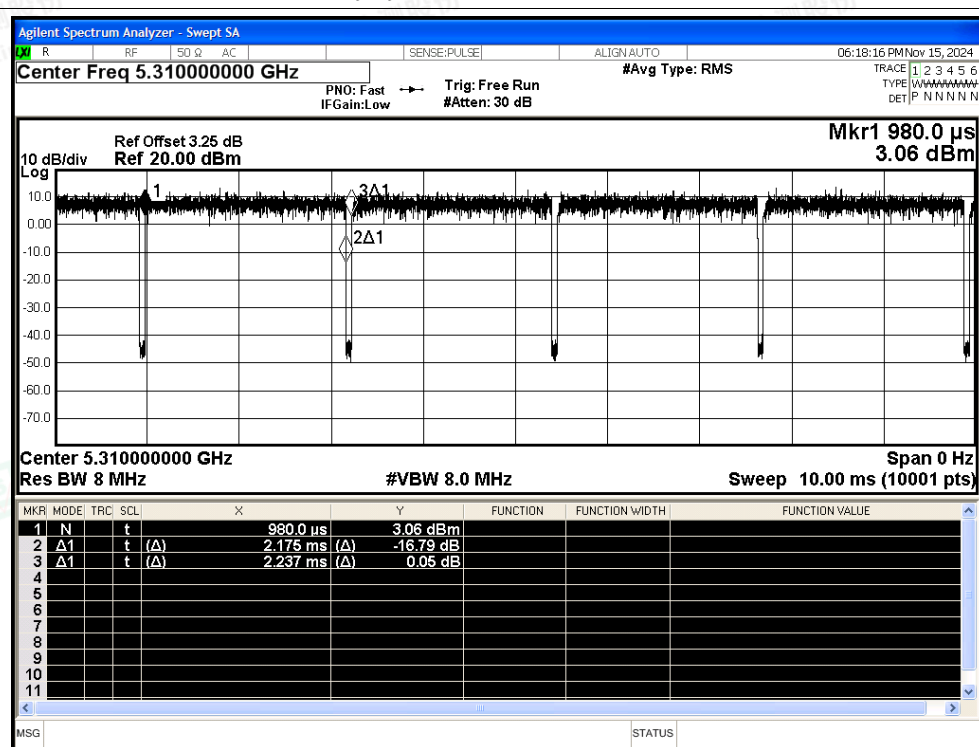




Duty Cycle NVNT ac20 5260MHz Ant3

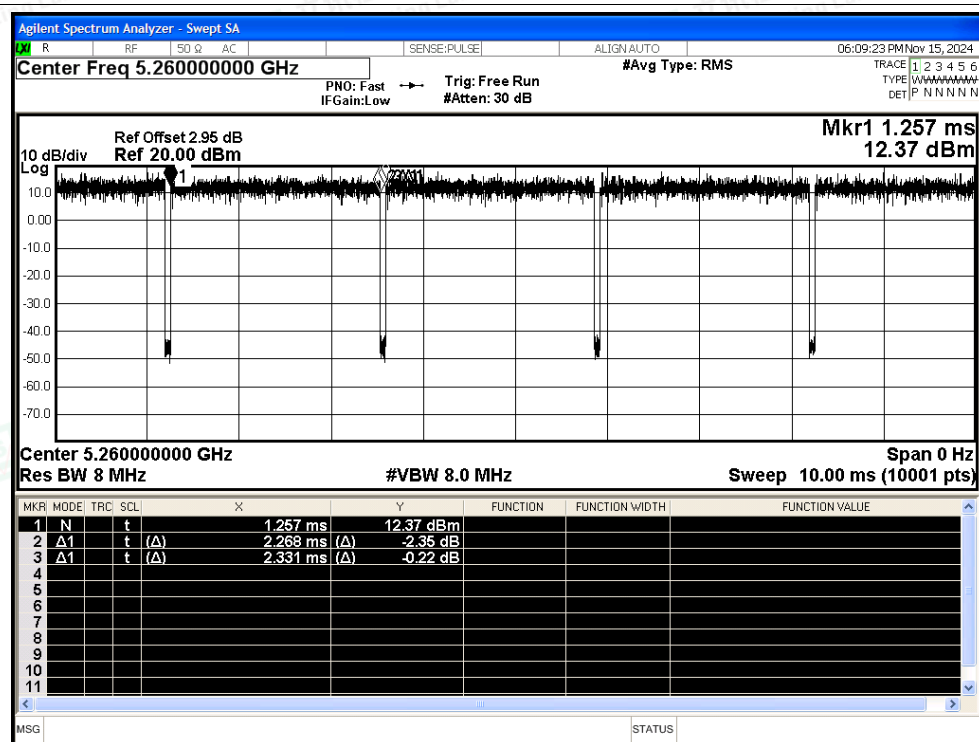


Duty Cycle NVNT ac20 5300MHz Ant3

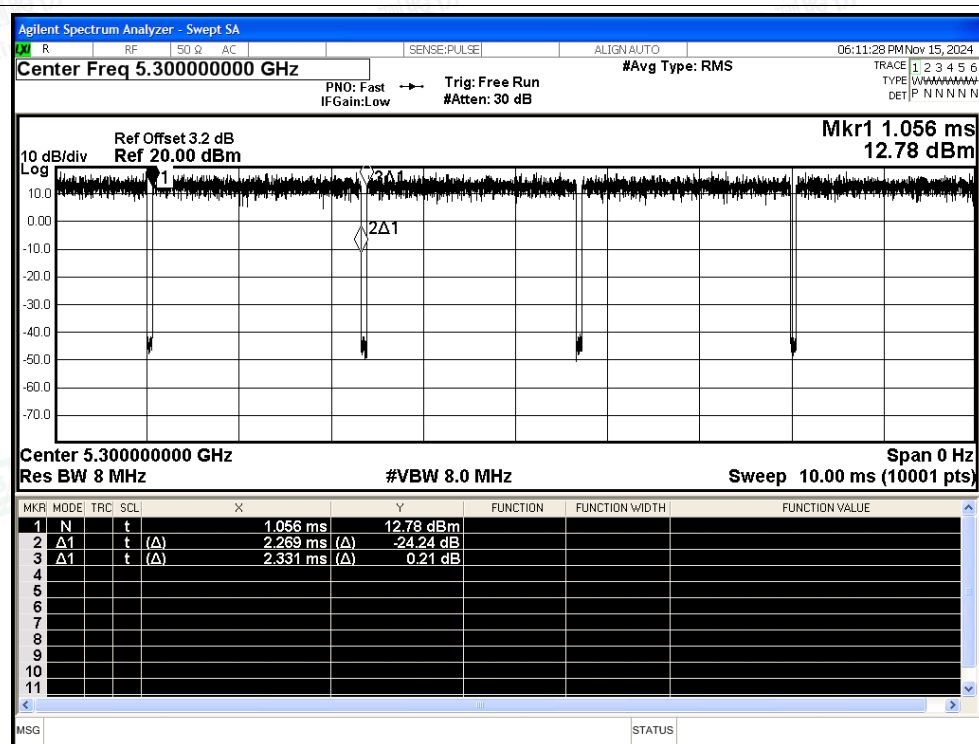




Duty Cycle NVNT ac20 5320MHz Ant3

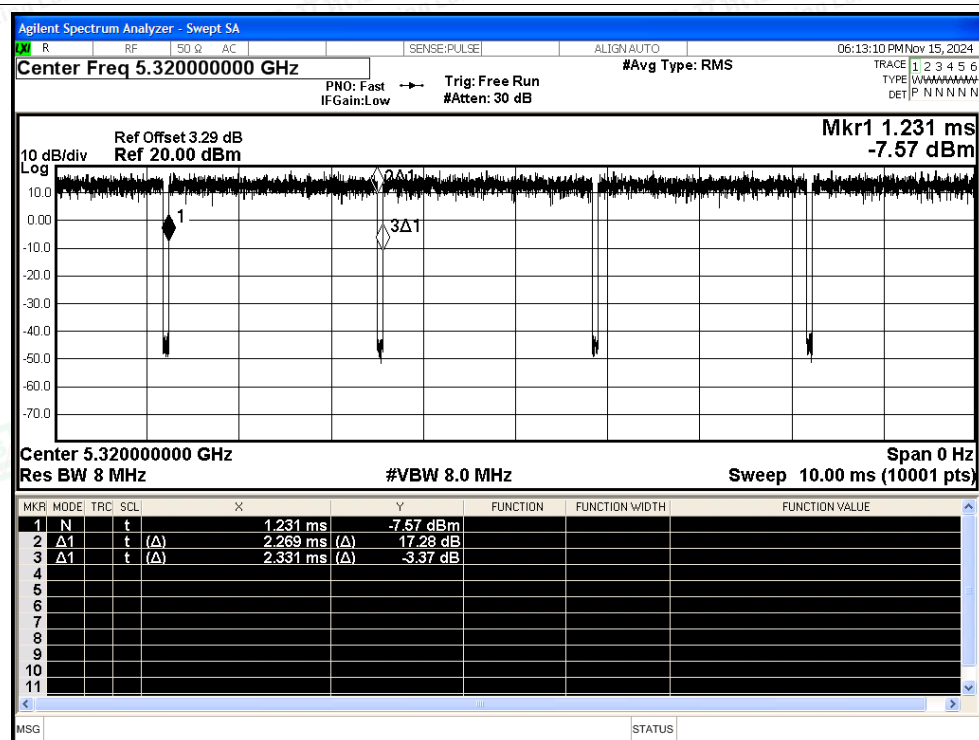


Duty Cycle NVNT ac40 5270MHz Ant3

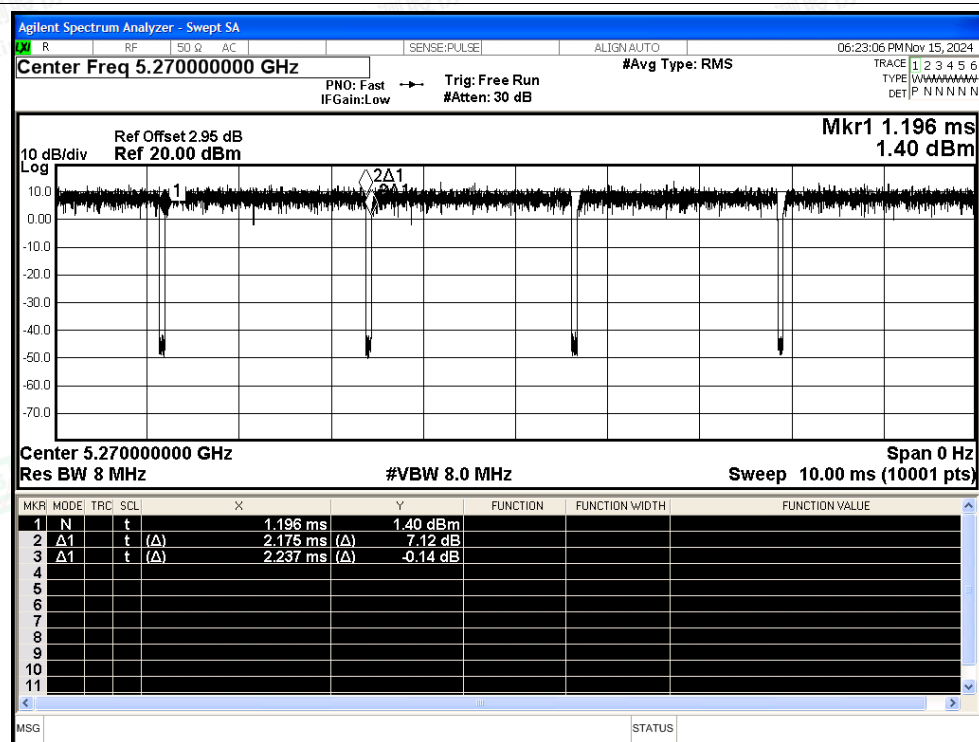




Duty Cycle NVNT ac40 5310MHz Ant3

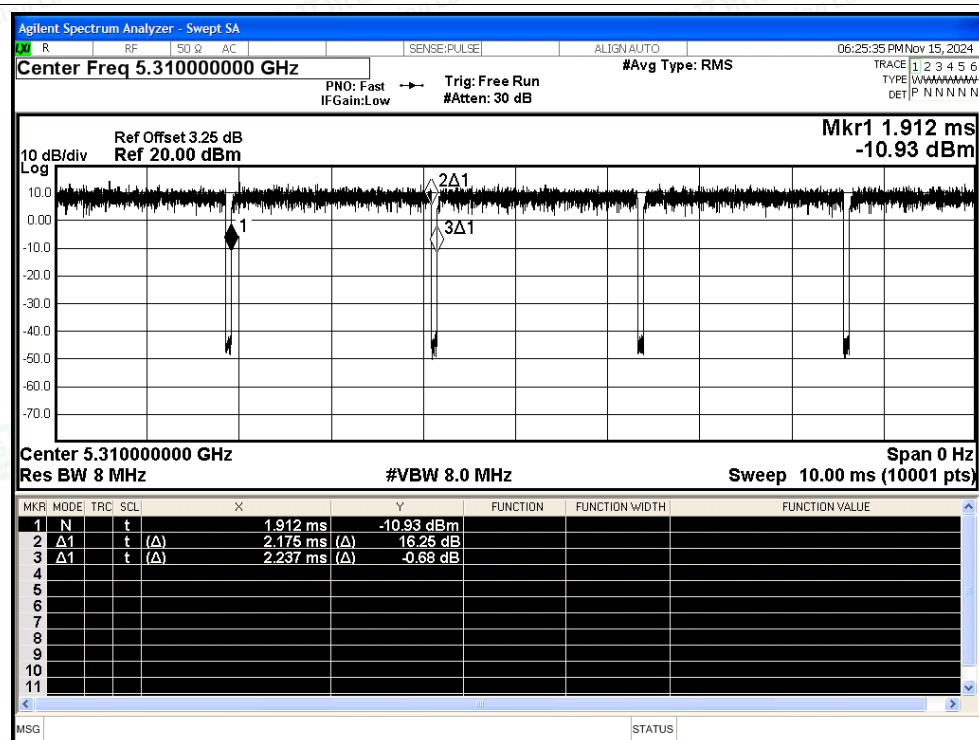

Duty Cycle NVNT ac80 5290MHz Ant3

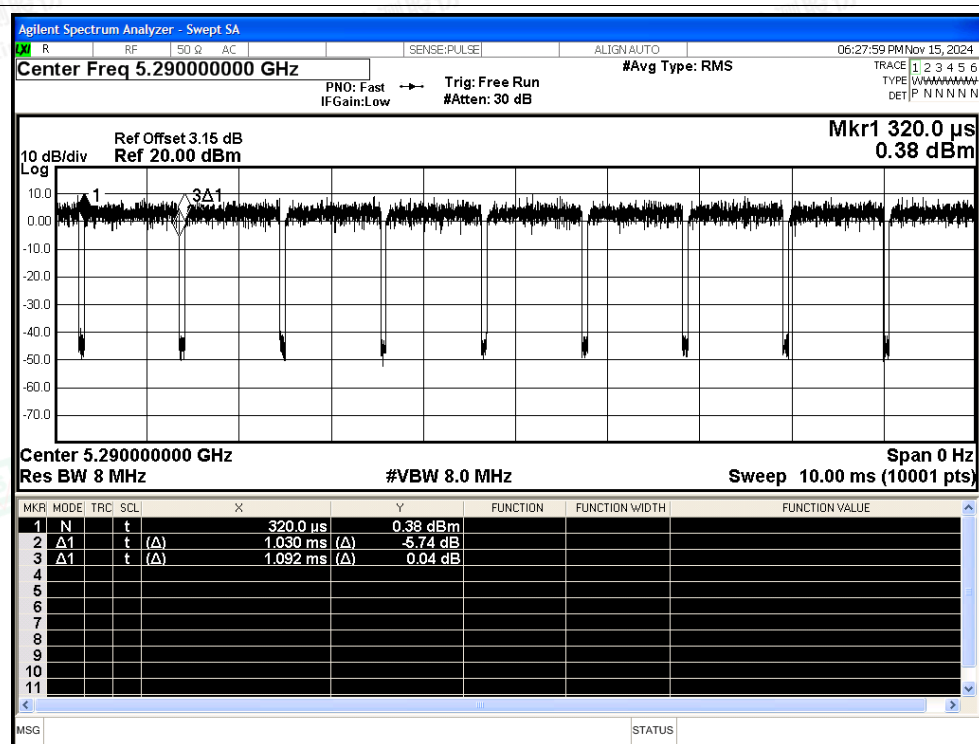

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5260MHz Ant3

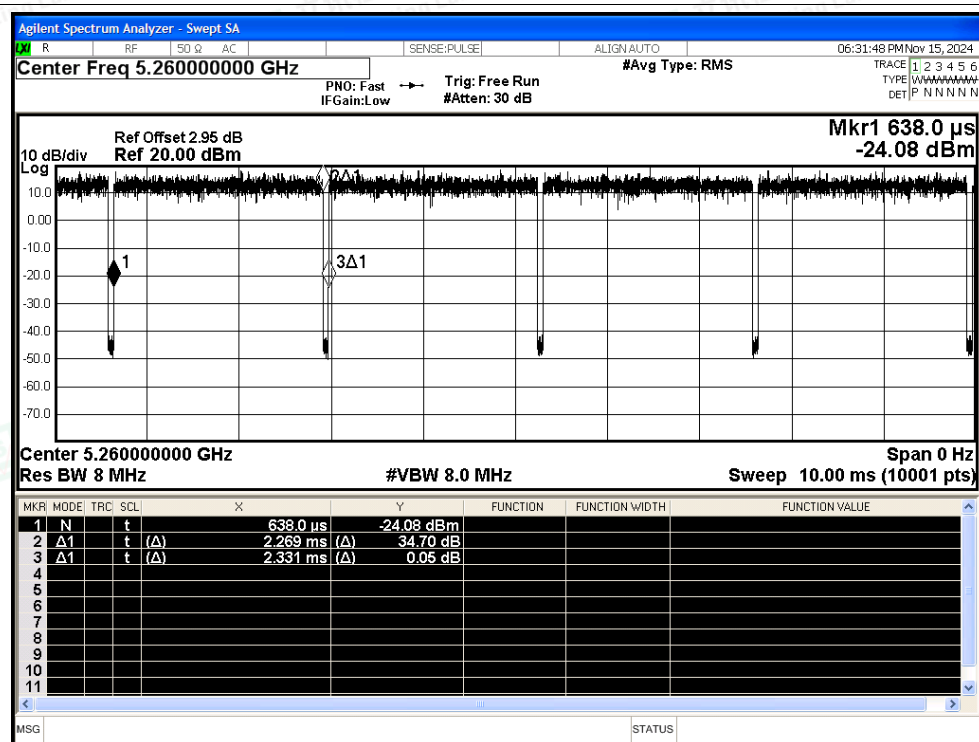


Duty Cycle NVNT ax20 5300MHz Ant3

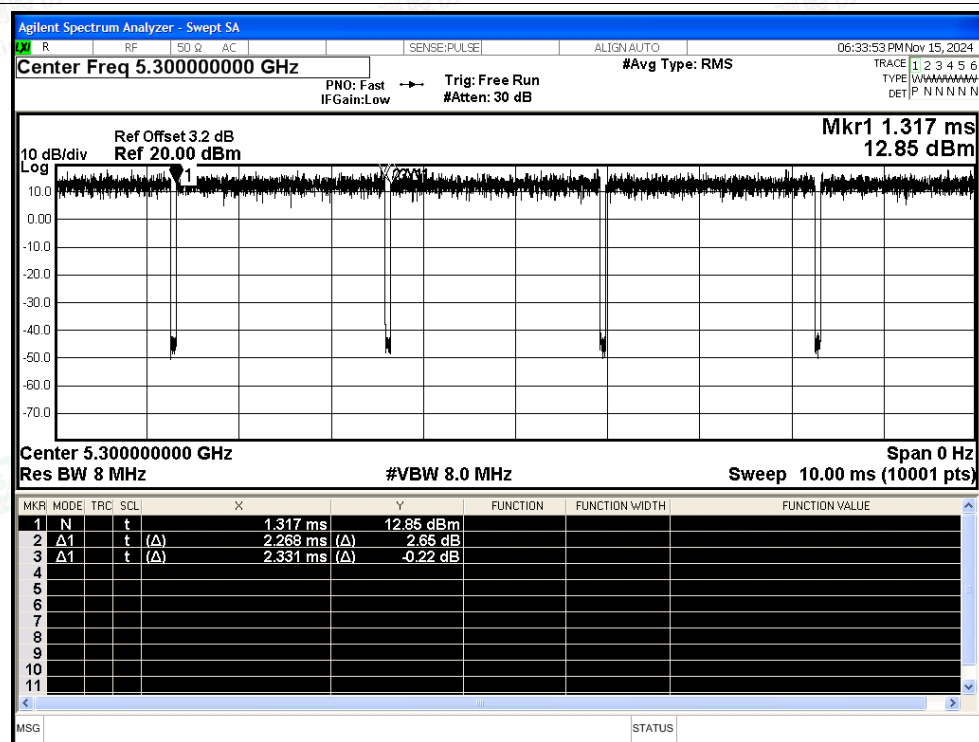




Duty Cycle NVNT ax20 5320MHz Ant3

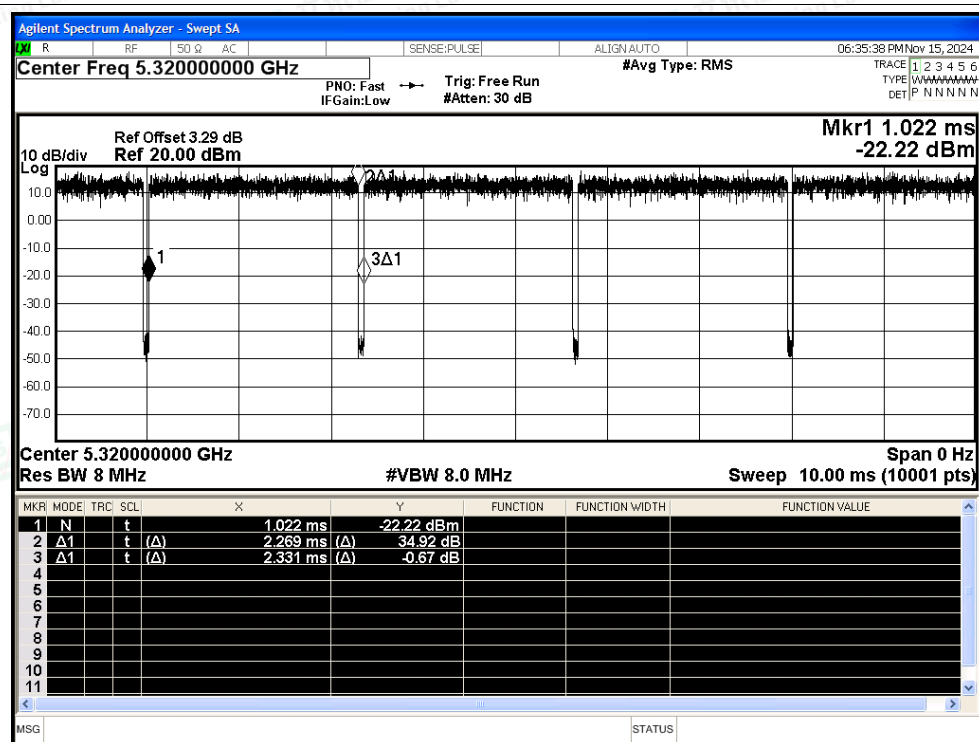


Duty Cycle NVNT ax40 5270MHz Ant3

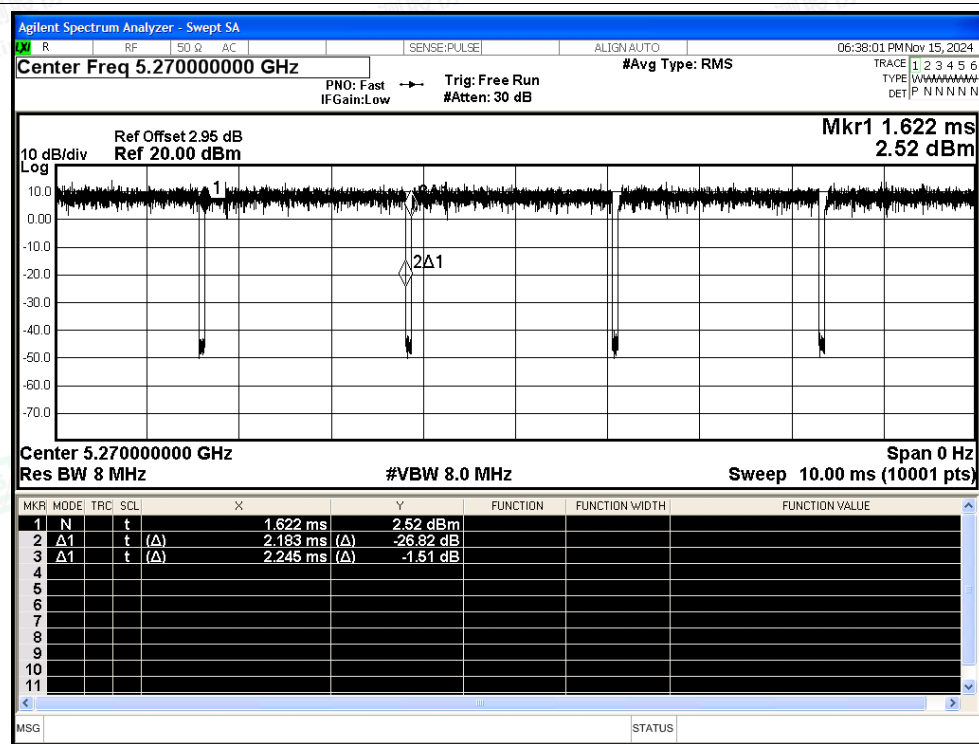




Duty Cycle NVNT ax40 5310MHz Ant3

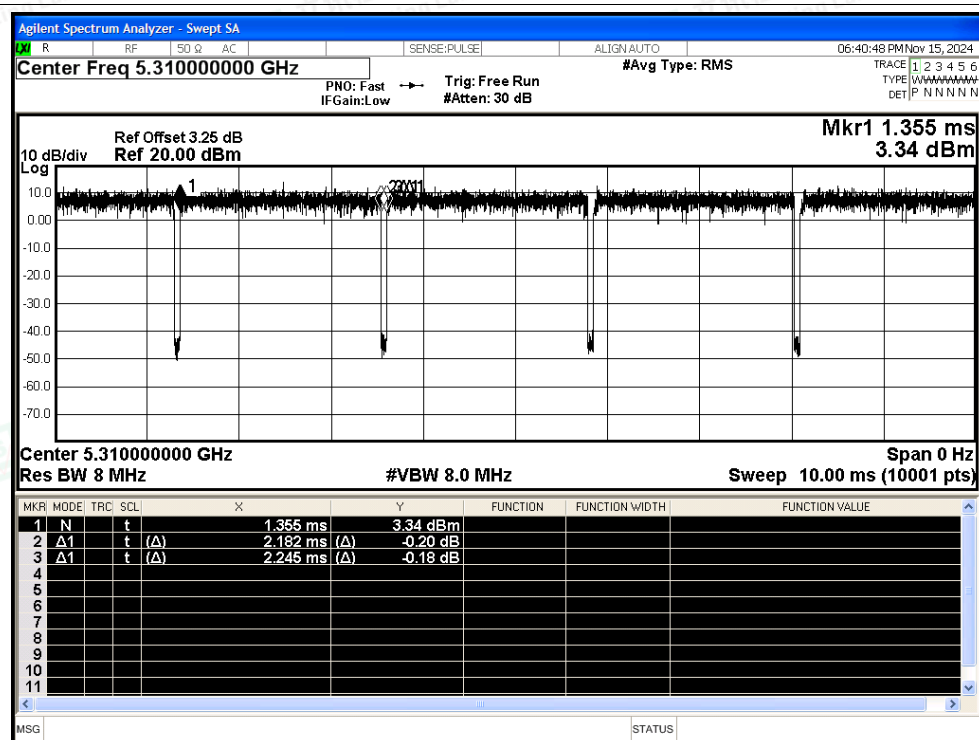


Duty Cycle NVNT ax80 5290MHz Ant3

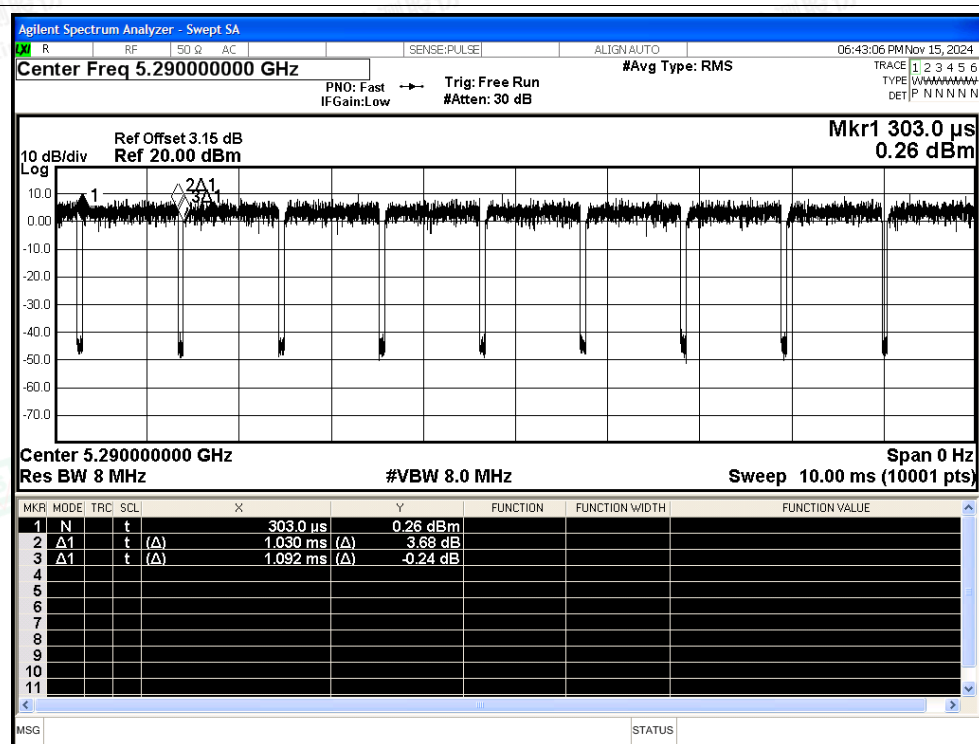




Duty Cycle NVNT ac160 5250MHz Ant3

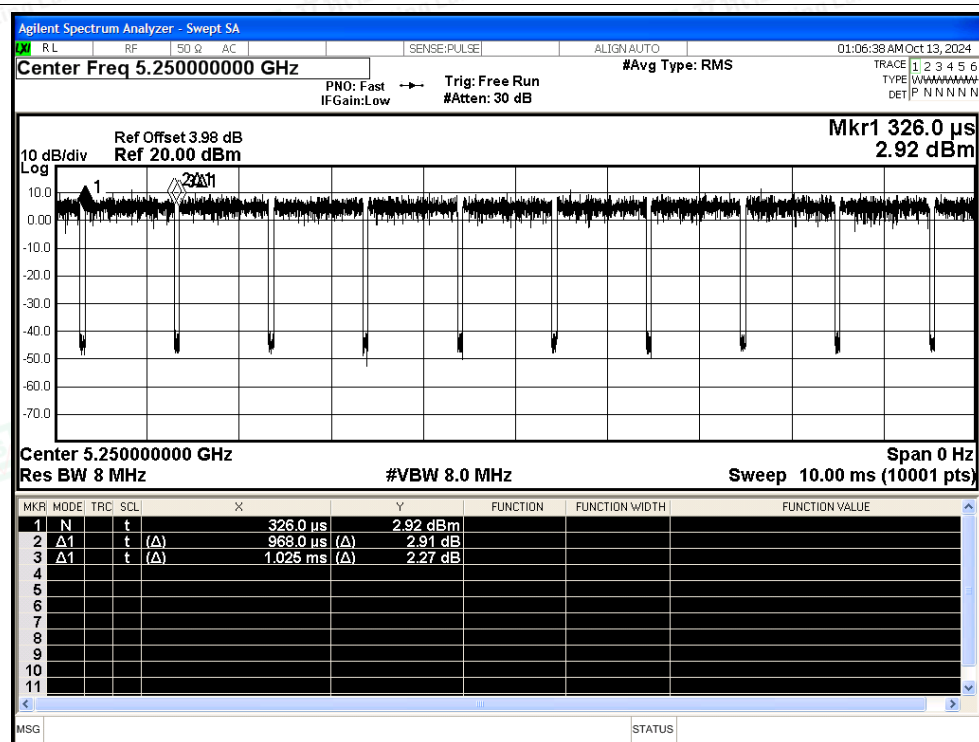

Duty Cycle NVNT ax160 5250MHz Ant3

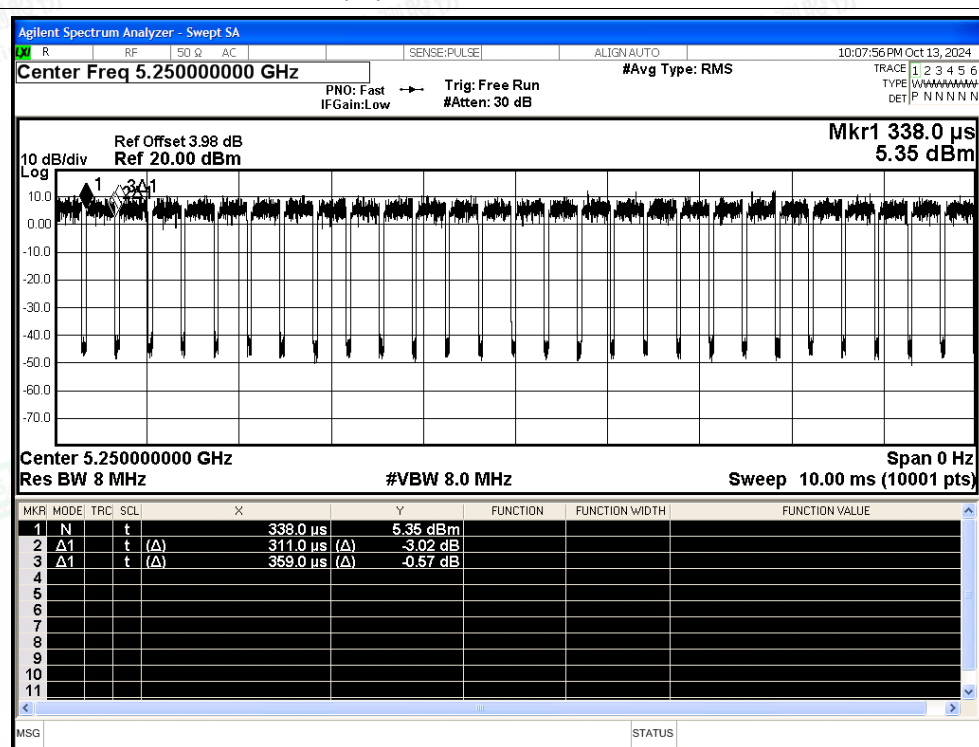




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant4	94.65	0.24	0.91
NVNT	a	5300	Ant4	94.56	0.24	0.91
NVNT	a	5320	Ant4	94.56	0.24	0.91
NVNT	n20	5260	Ant4	97.29	0.12	0.44
NVNT	n20	5300	Ant4	97.29	0.12	0.44
NVNT	n20	5320	Ant4	97.29	0.12	0.44
NVNT	n40	5270	Ant4	97.23	0.12	0.46
NVNT	n40	5310	Ant4	97.18	0.12	0.46
NVNT	ac20	5260	Ant4	97.34	0.12	0.44
NVNT	ac20	5300	Ant4	97.3	0.12	0.44
NVNT	ac20	5320	Ant4	97.34	0.12	0.44
NVNT	ac40	5270	Ant4	97.19	0.12	0.46
NVNT	ac40	5310	Ant4	97.24	0.12	0.46
NVNT	ac80	5290	Ant4	94.32	0.25	0.97
NVNT	ax20	5260	Ant4	97.34	0.12	0.44
NVNT	ax20	5300	Ant4	97.34	0.12	0.44
NVNT	ax20	5320	Ant4	97.34	0.12	0.44
NVNT	ax40	5270	Ant4	97.19	0.12	0.46
NVNT	ax40	5310	Ant4	97.24	0.12	0.46
NVNT	ax80	5290	Ant4	94.32	0.25	0.97
NVNT	ac160	5250	Ant4	94.53	0.24	1.03
NVNT	ax160	5250	Ant4	86.59	0.63	3.23






Test Graphs

Duty Cycle NVNT a 5260MHz Ant4

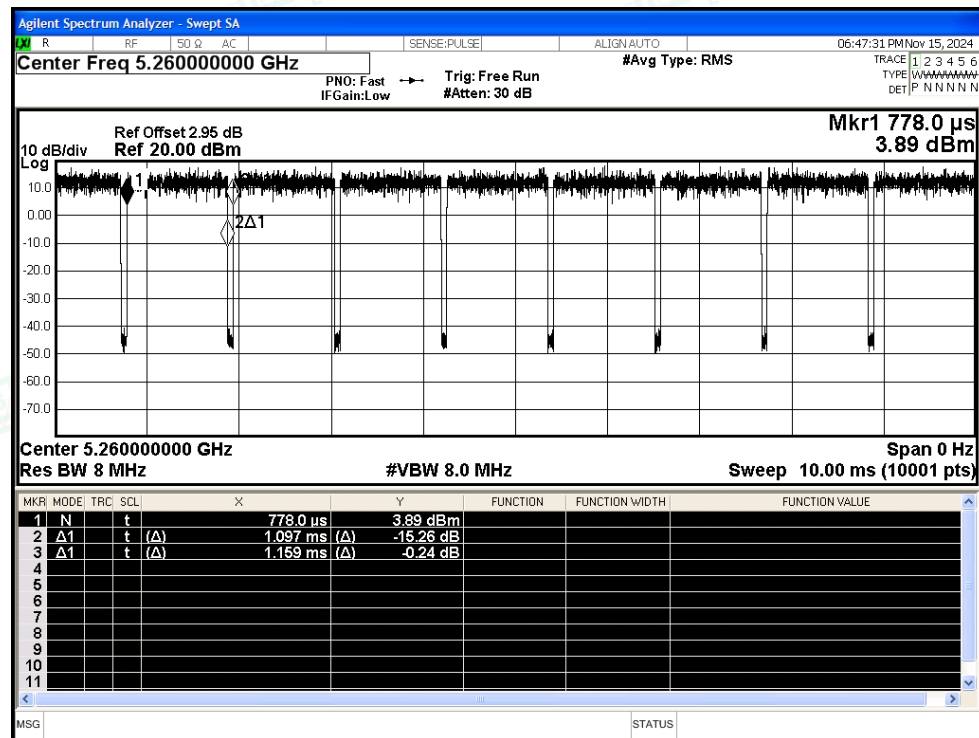


Duty Cycle NVNT a 5300MHz Ant4

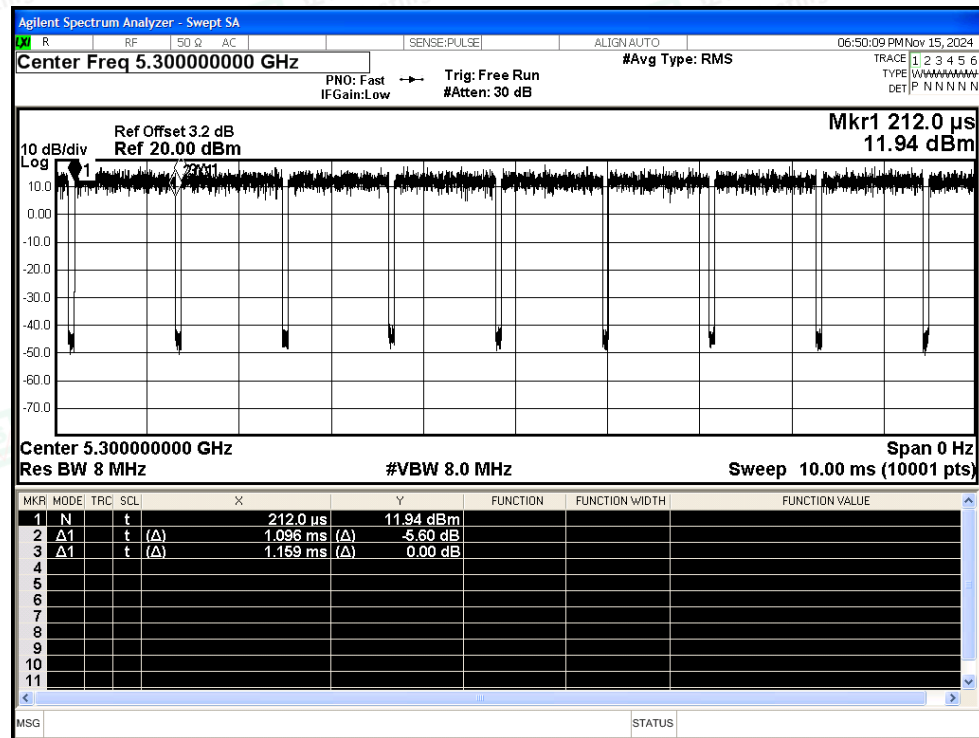




Duty Cycle NVNT a 5320MHz Ant4

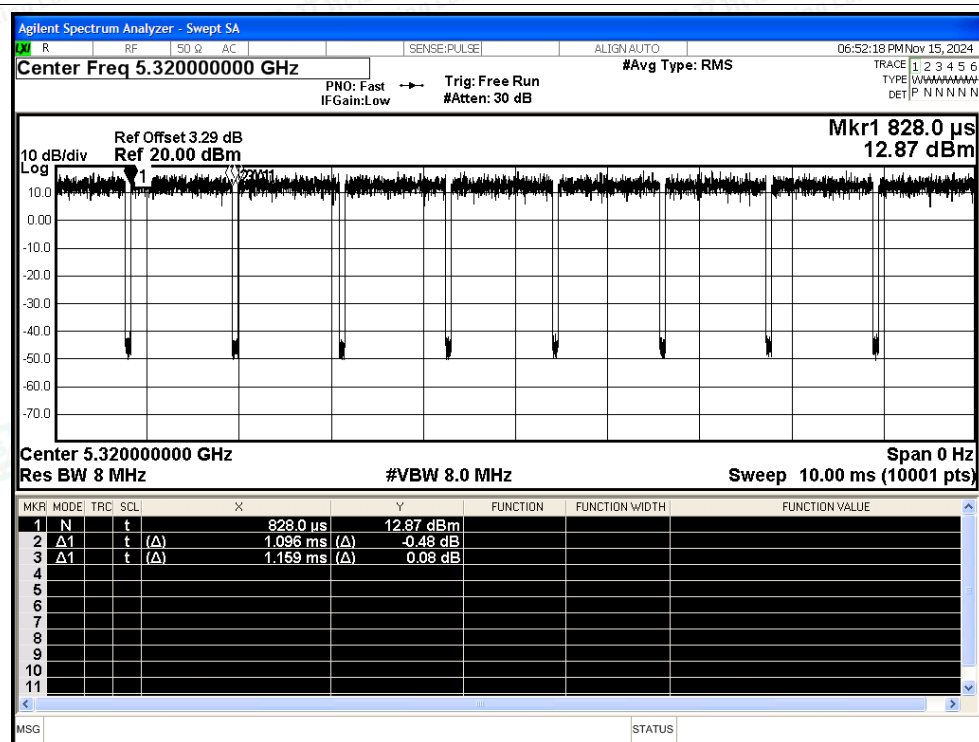


Duty Cycle NVNT n20 5260MHz Ant4

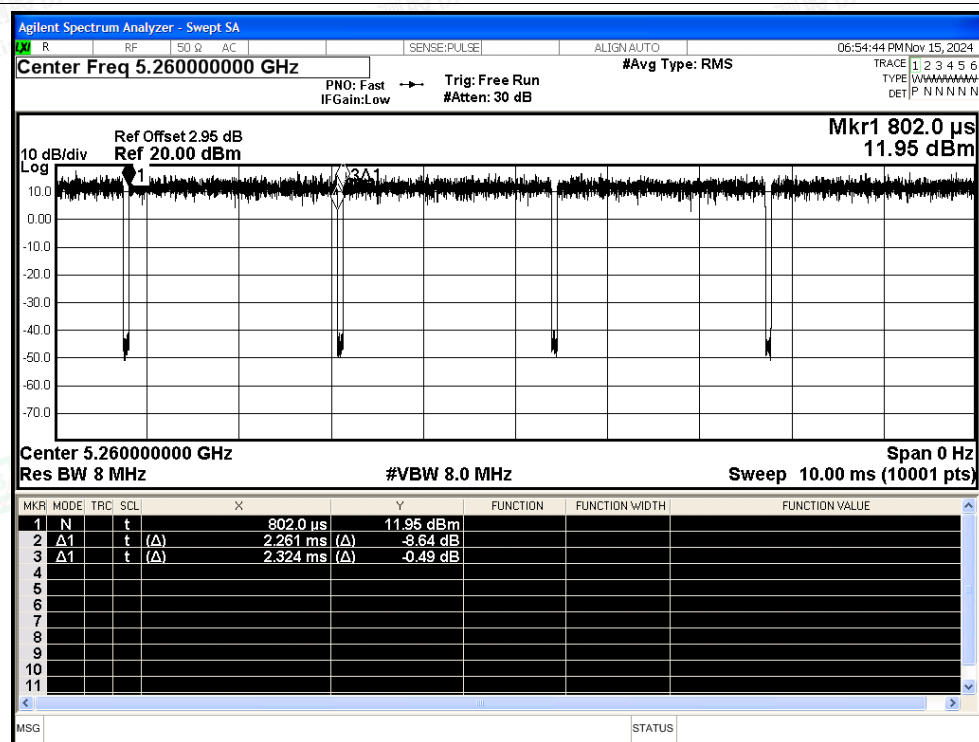




Duty Cycle NVNT n20 5300MHz Ant4

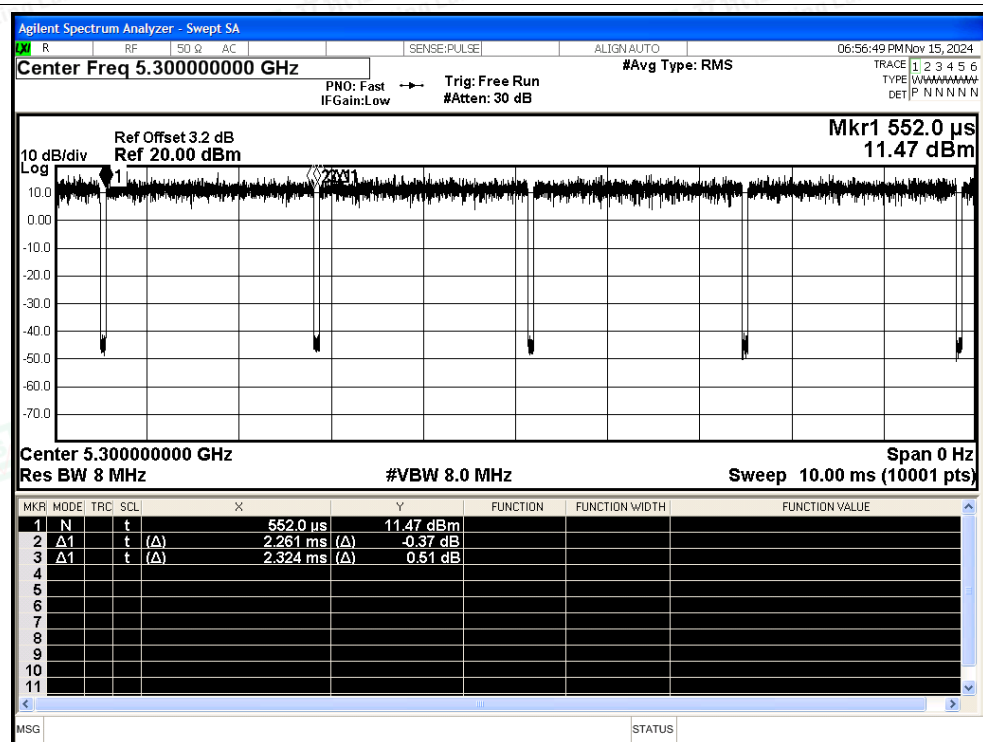


Duty Cycle NVNT n20 5320MHz Ant4

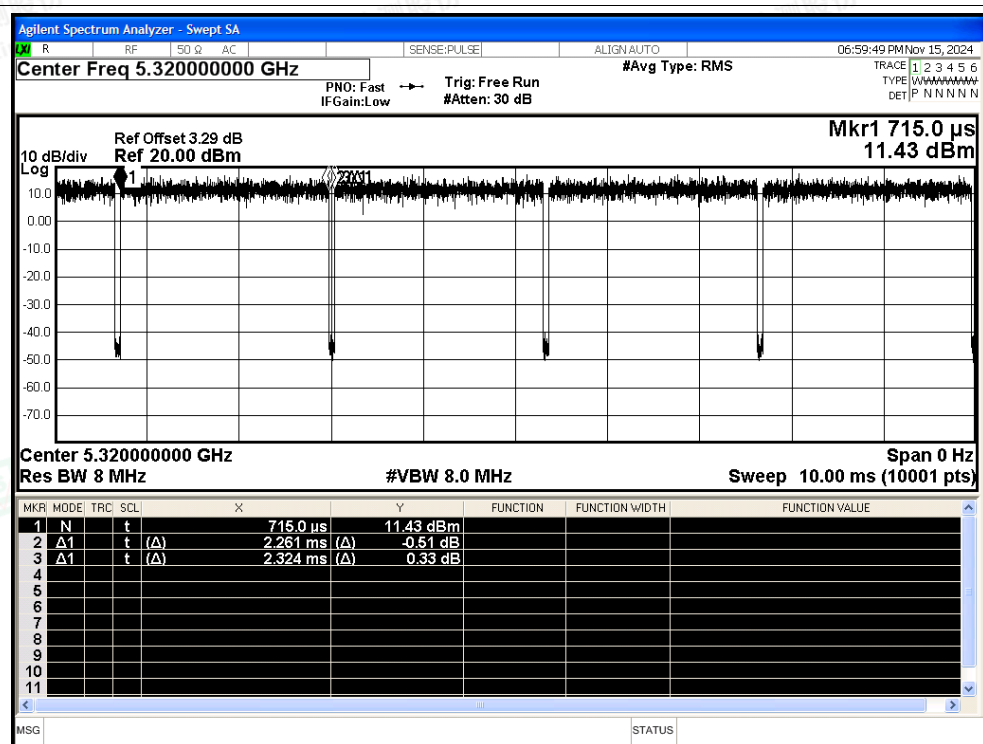




Duty Cycle NVNT n40 5270MHz Ant4

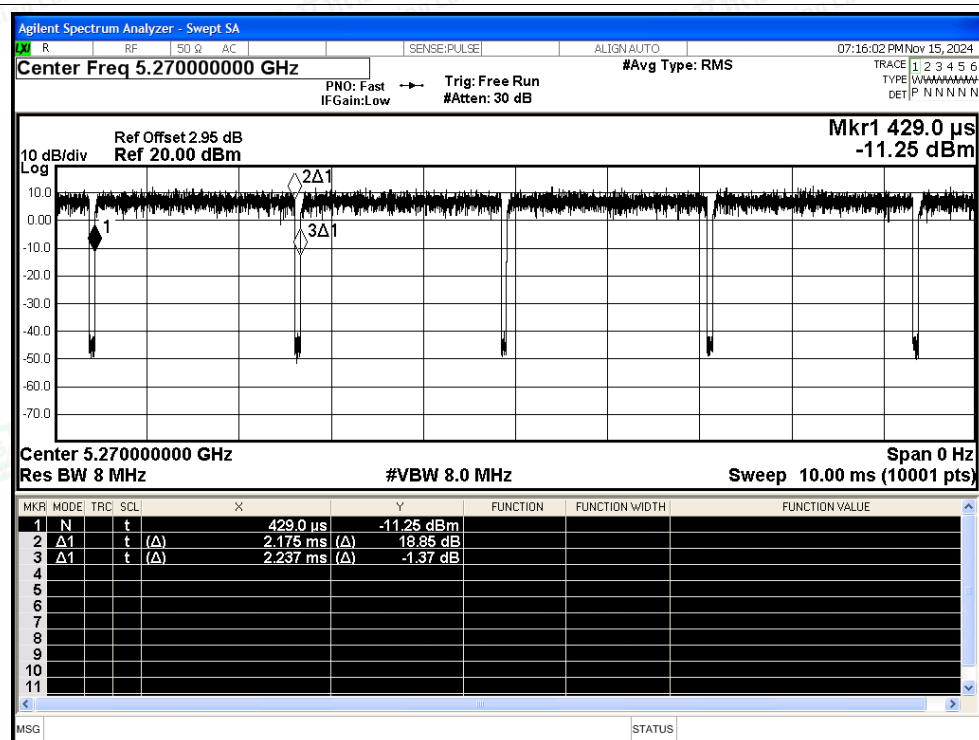

Duty Cycle NVNT n40 5310MHz Ant4

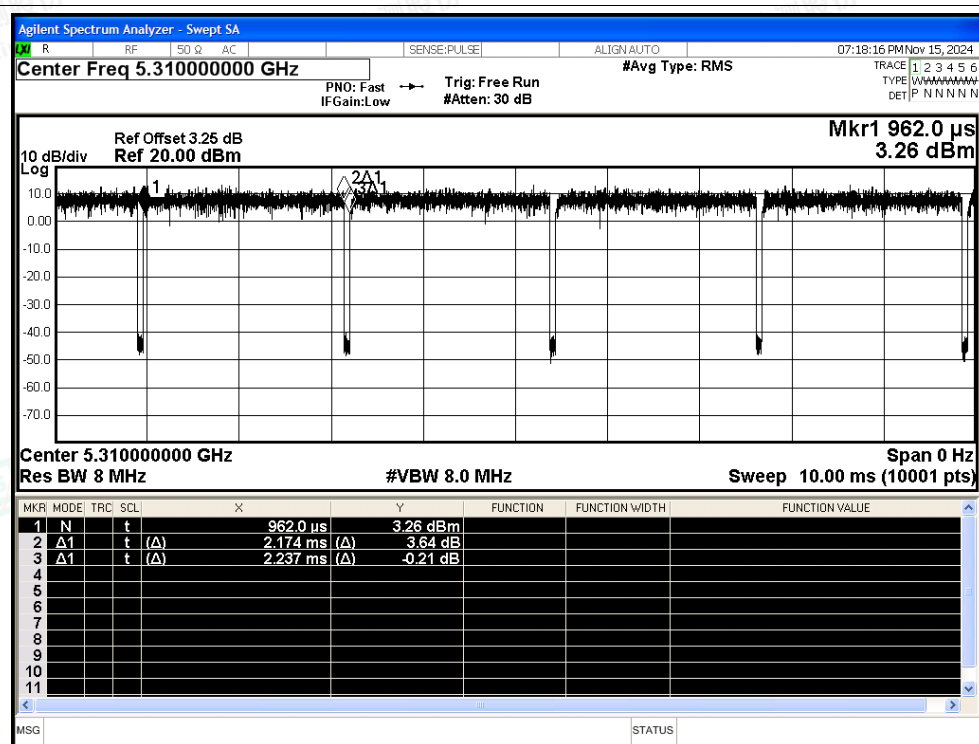

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant4

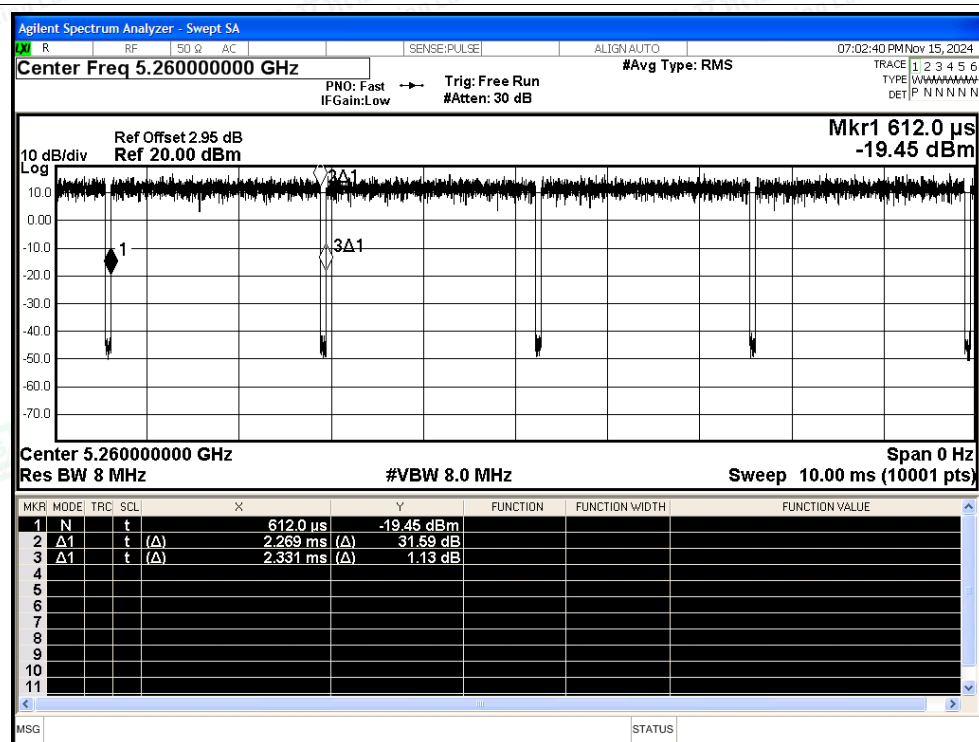


Duty Cycle NVNT ac20 5300MHz Ant4

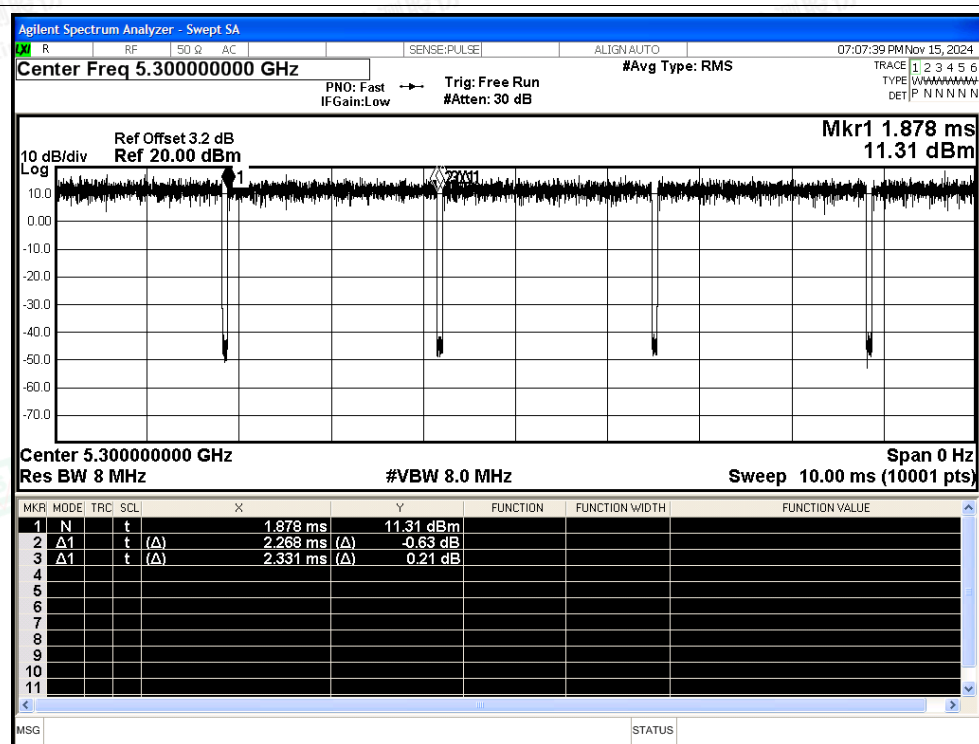




Duty Cycle NVNT ac20 5320MHz Ant4

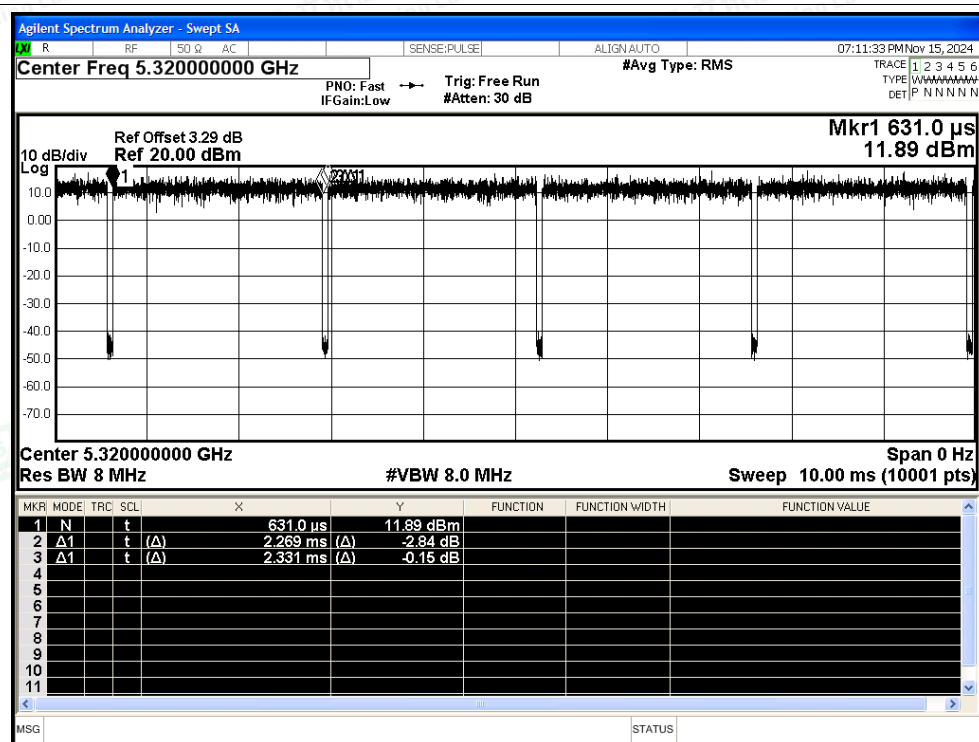

Duty Cycle NVNT ac40 5270MHz Ant4

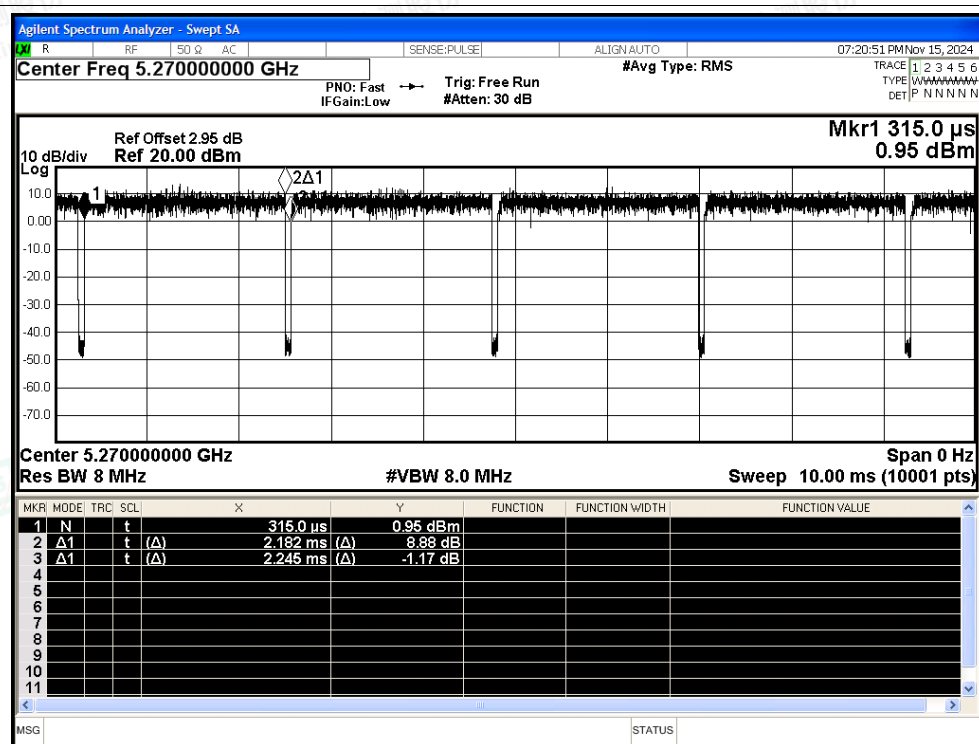

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant4

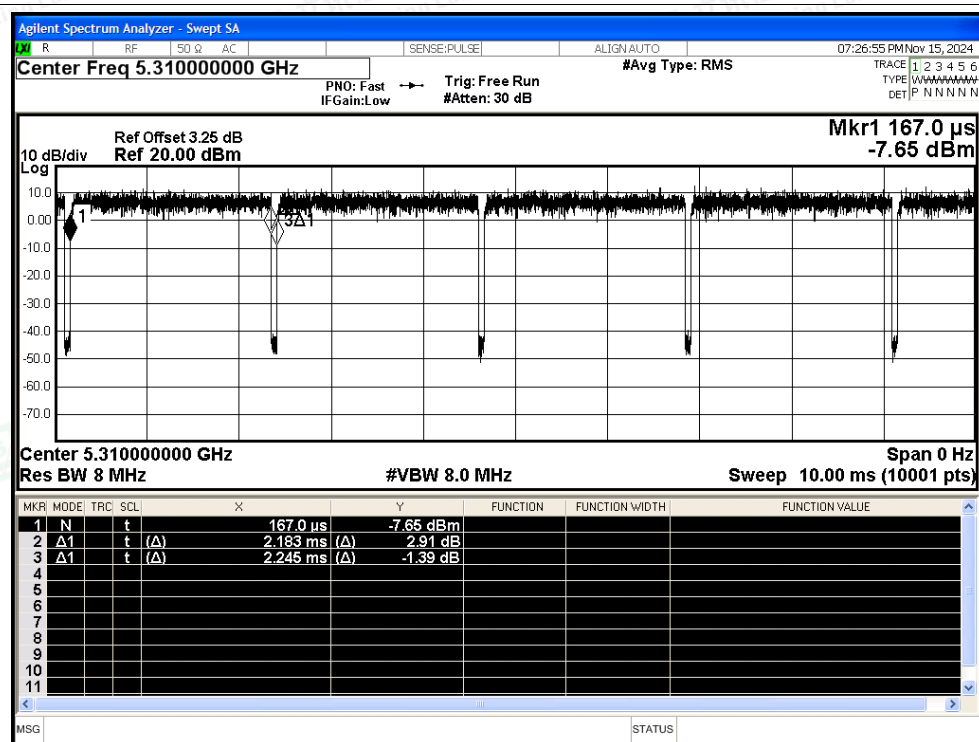


Duty Cycle NVNT ac80 5290MHz Ant4

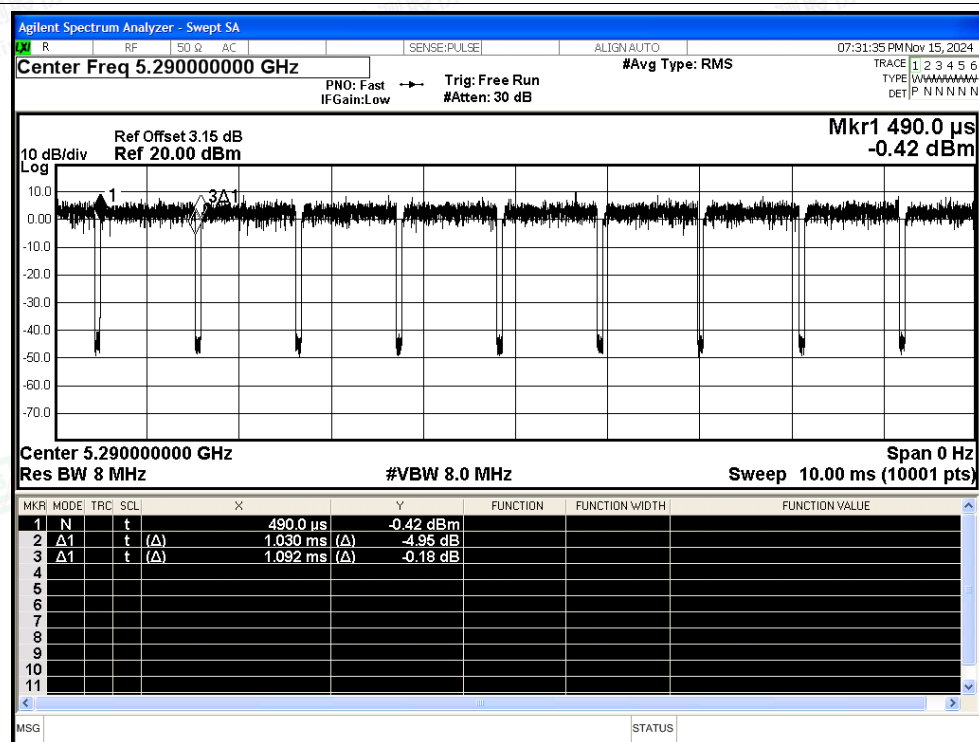




Duty Cycle NVNT ax20 5260MHz Ant4

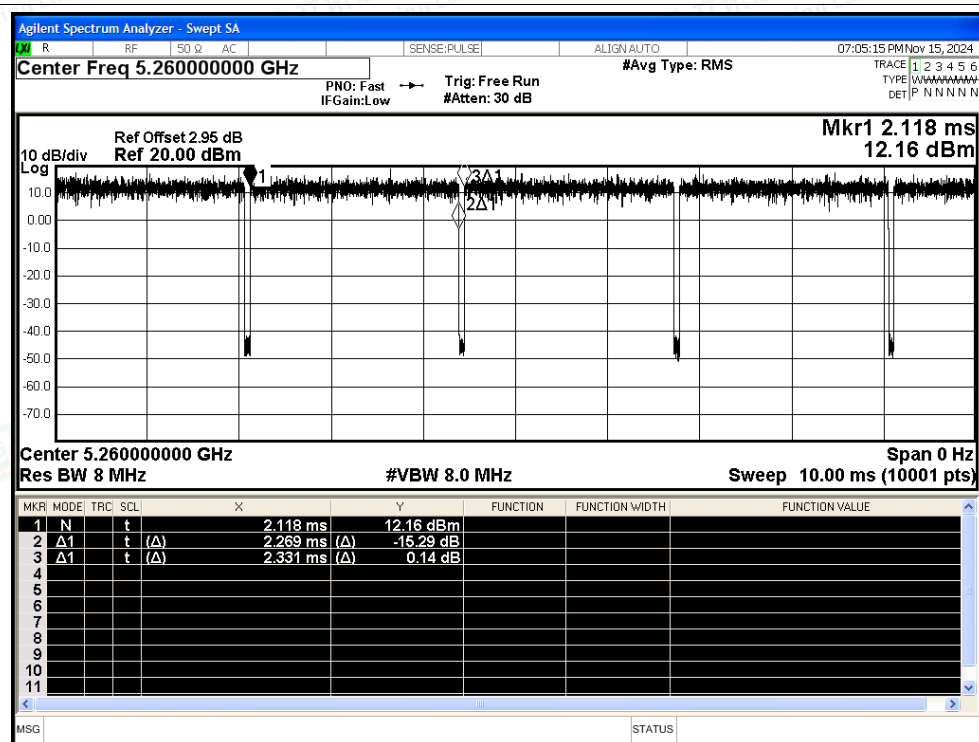


Duty Cycle NVNT ax20 5300MHz Ant4

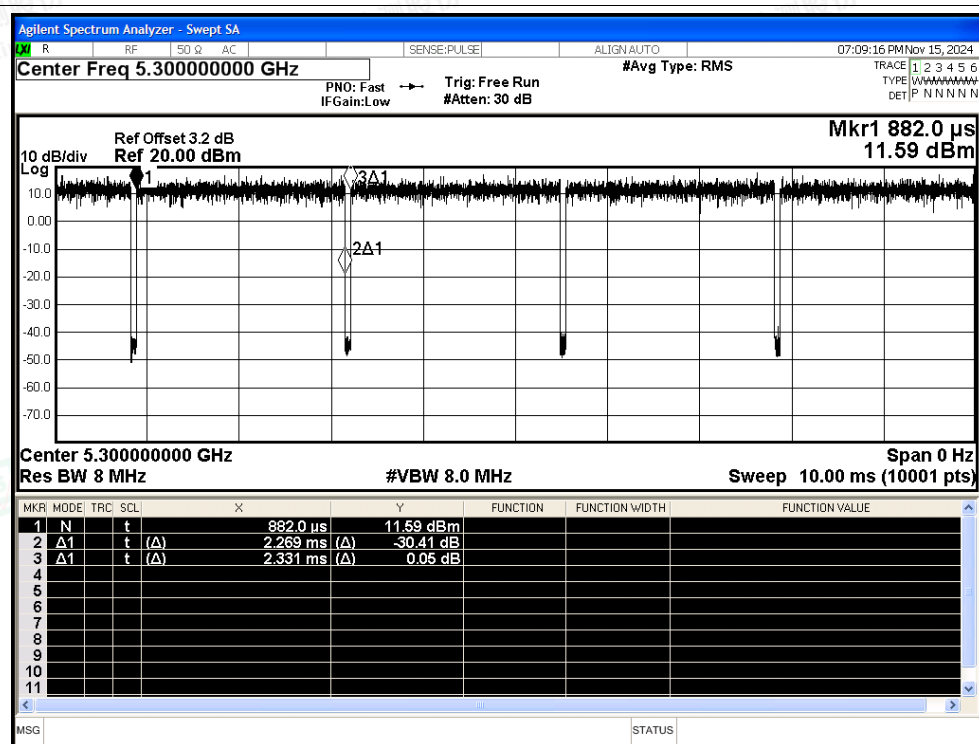




Duty Cycle NVNT ax20 5320MHz Ant4

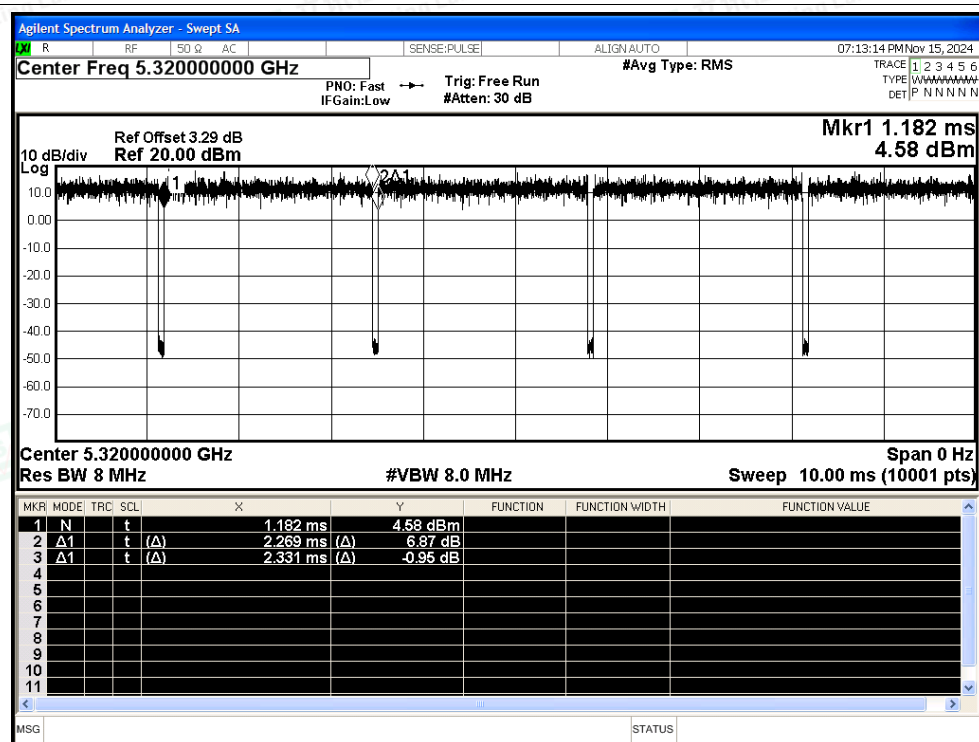


Duty Cycle NVNT ax40 5270MHz Ant4

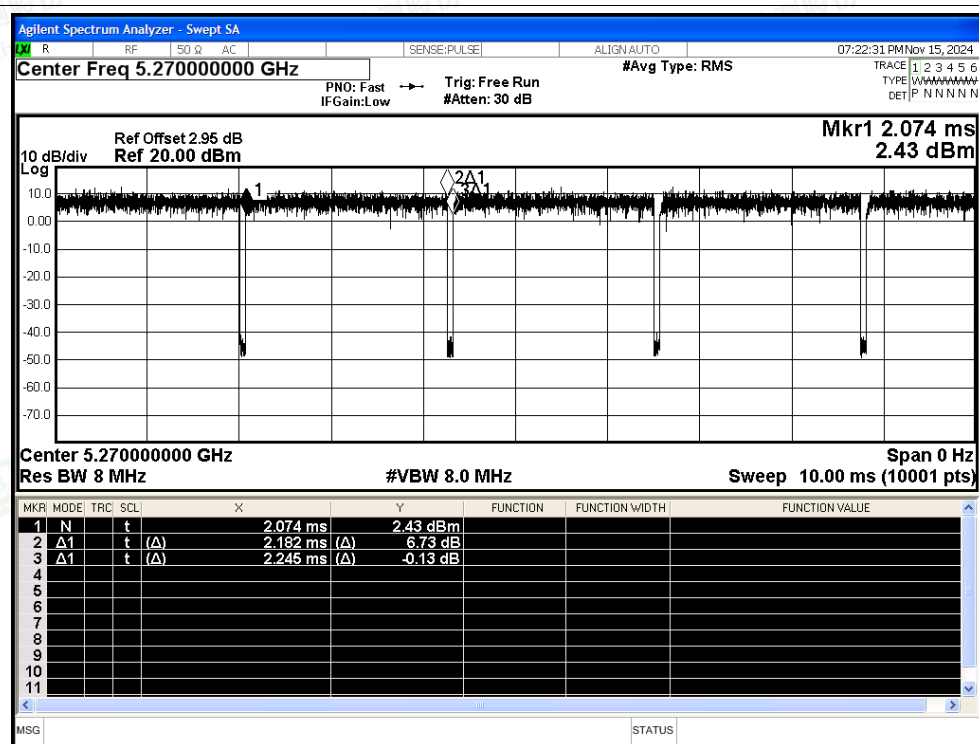




Duty Cycle NVNT ax40 5310MHz Ant4

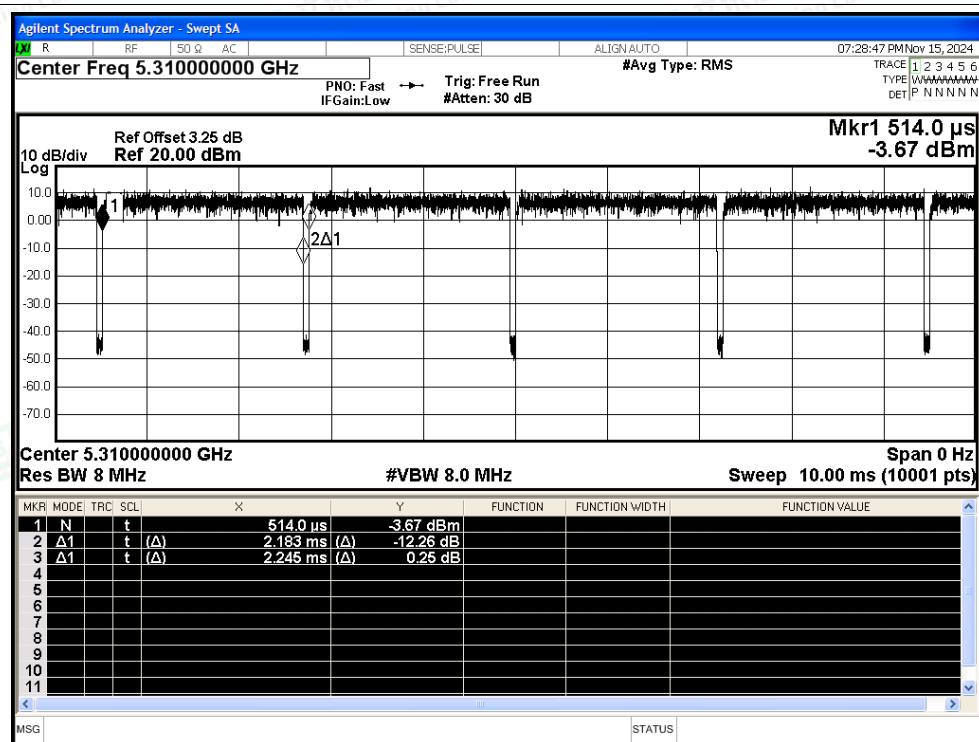


Duty Cycle NVNT ax80 5290MHz Ant4

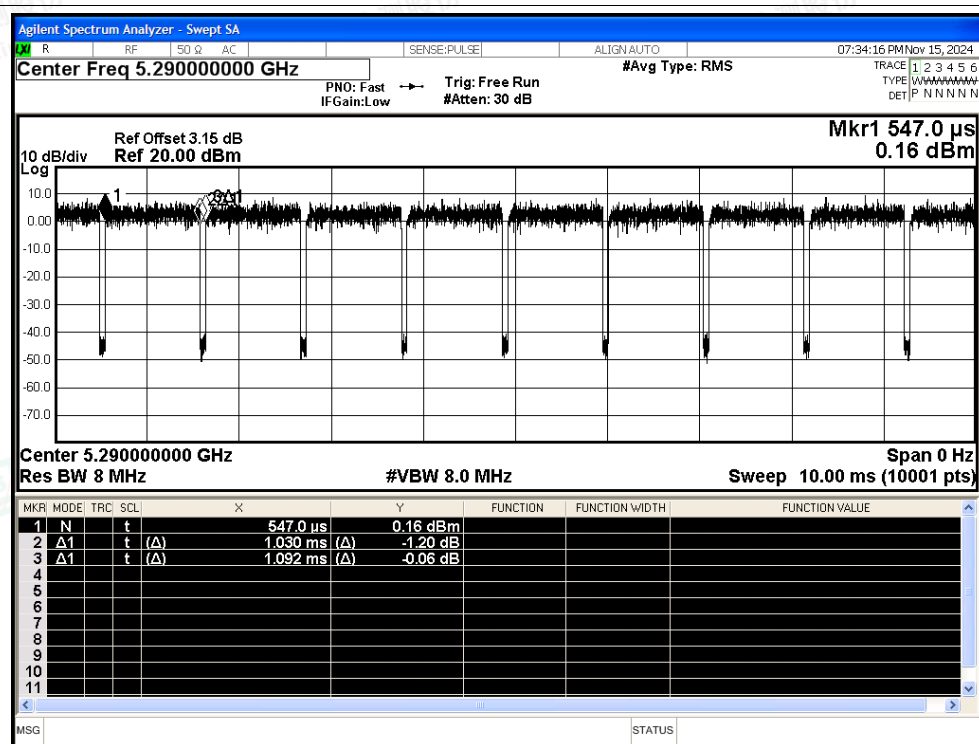

Duty Cycle NVNT ac160 5250MHz Ant4



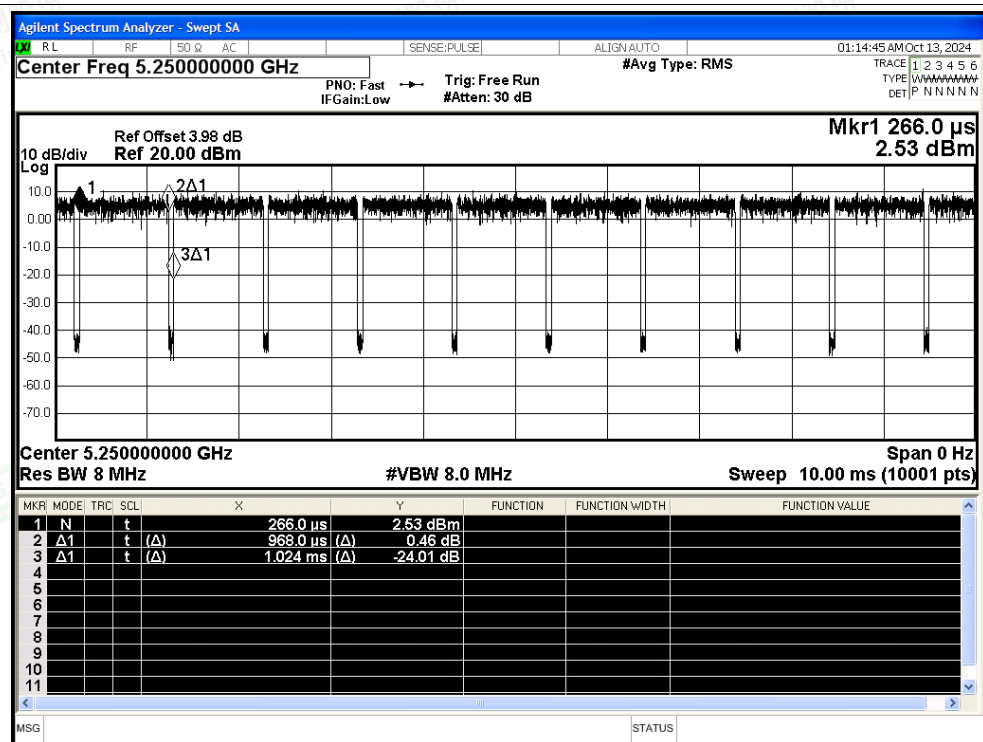

Duty Cycle NVNT ax160 5250MHz Ant4

