





Freq. Stability NVNT n40 5510MHz Ant4

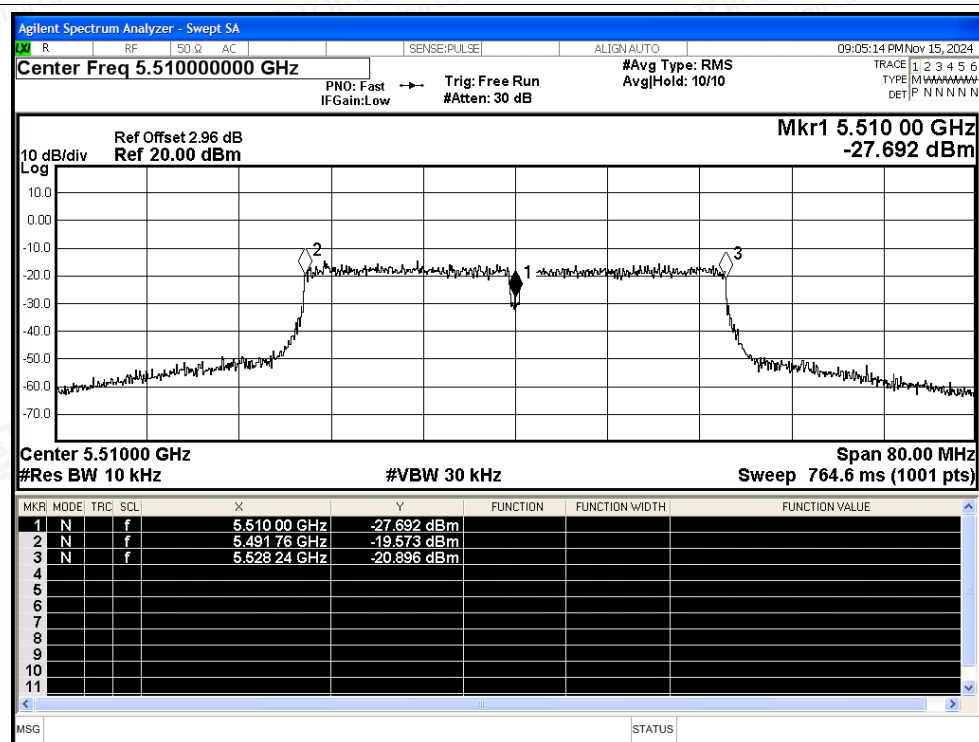

Freq. Stability NVNT n40 5550MHz Ant4

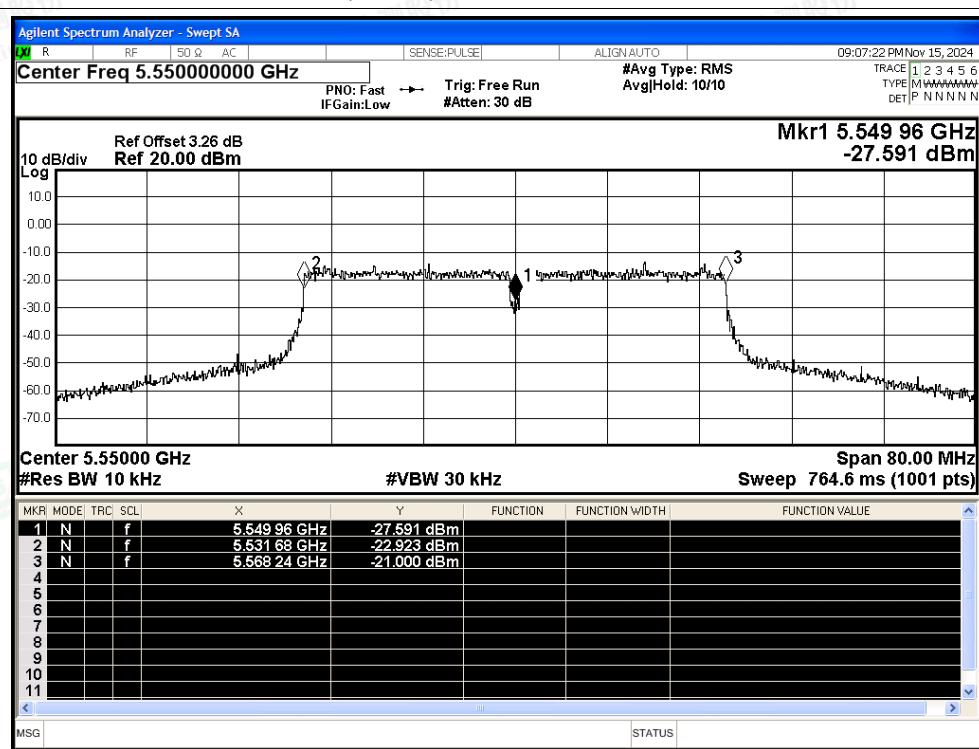

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5670MHz Ant4

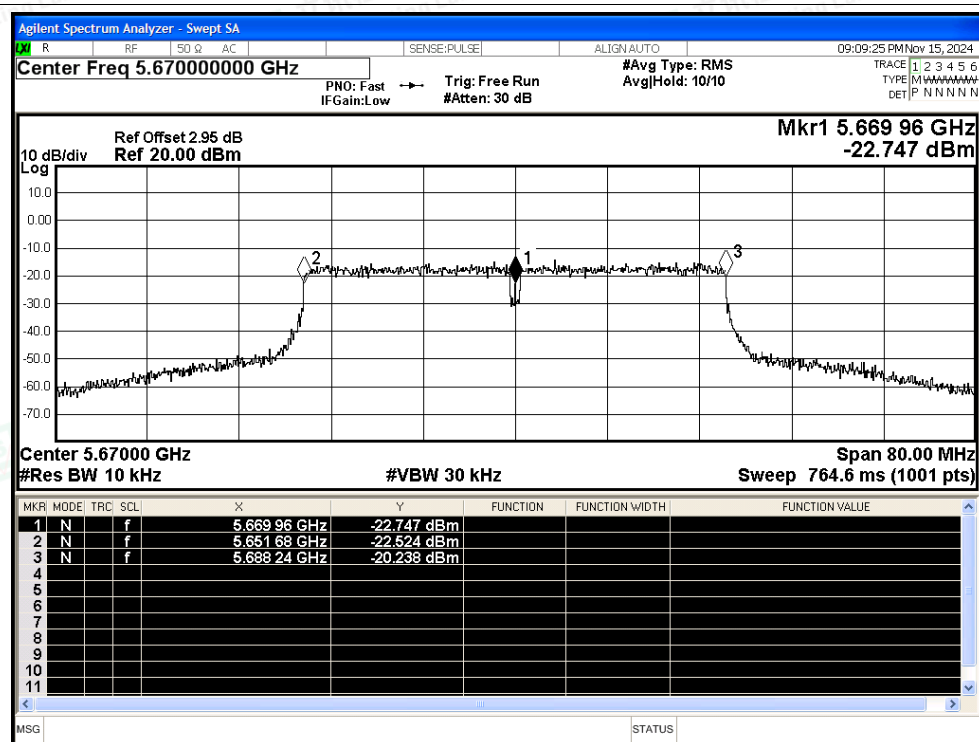

Freq. Stability NVNT ac20 5500MHz Ant4

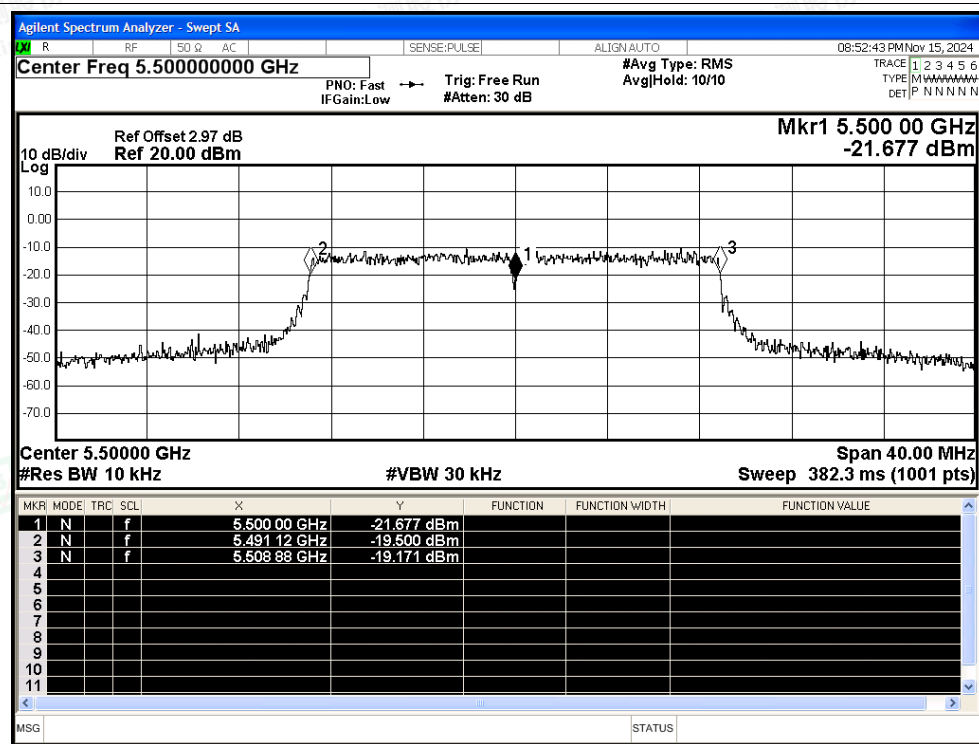

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5580MHz Ant4

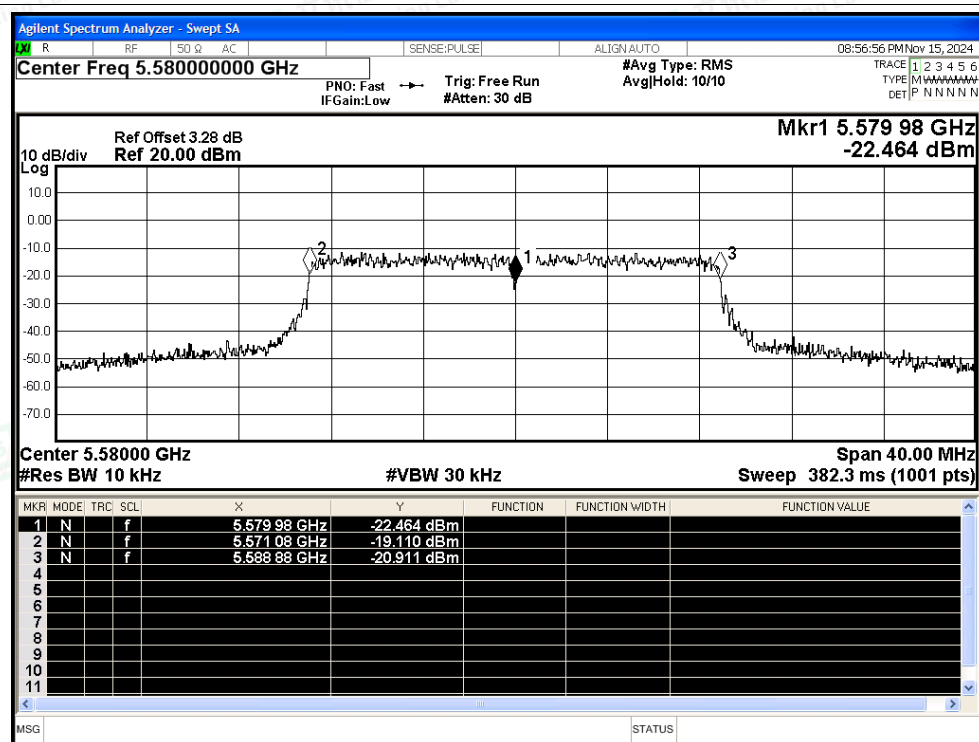

Freq. Stability NVNT ac20 5700MHz Ant4

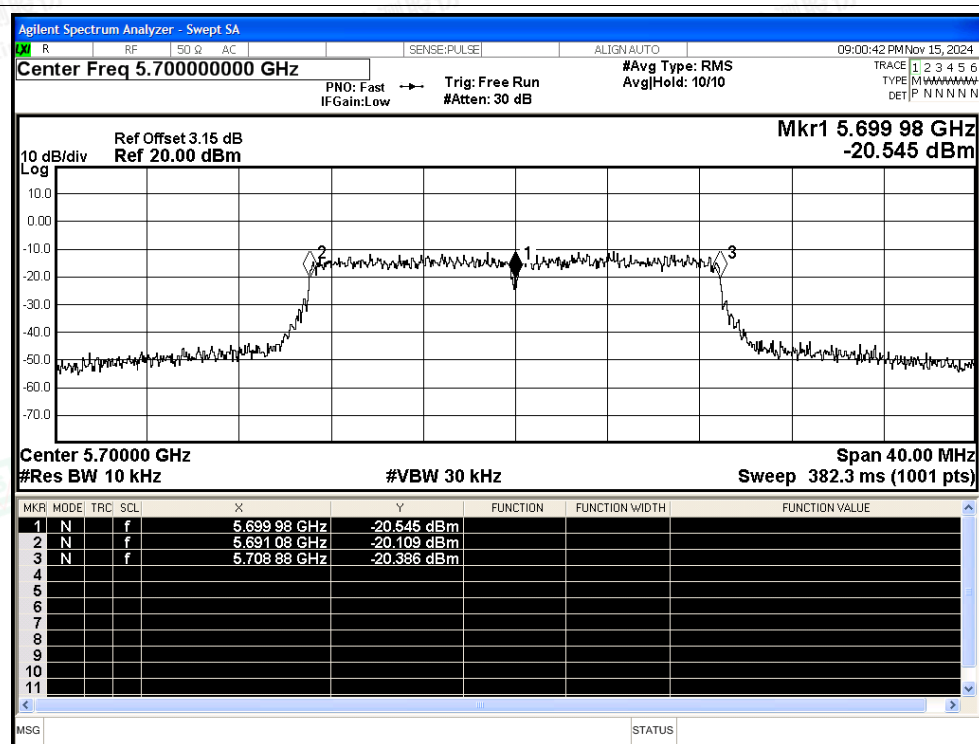

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5510MHz Ant4

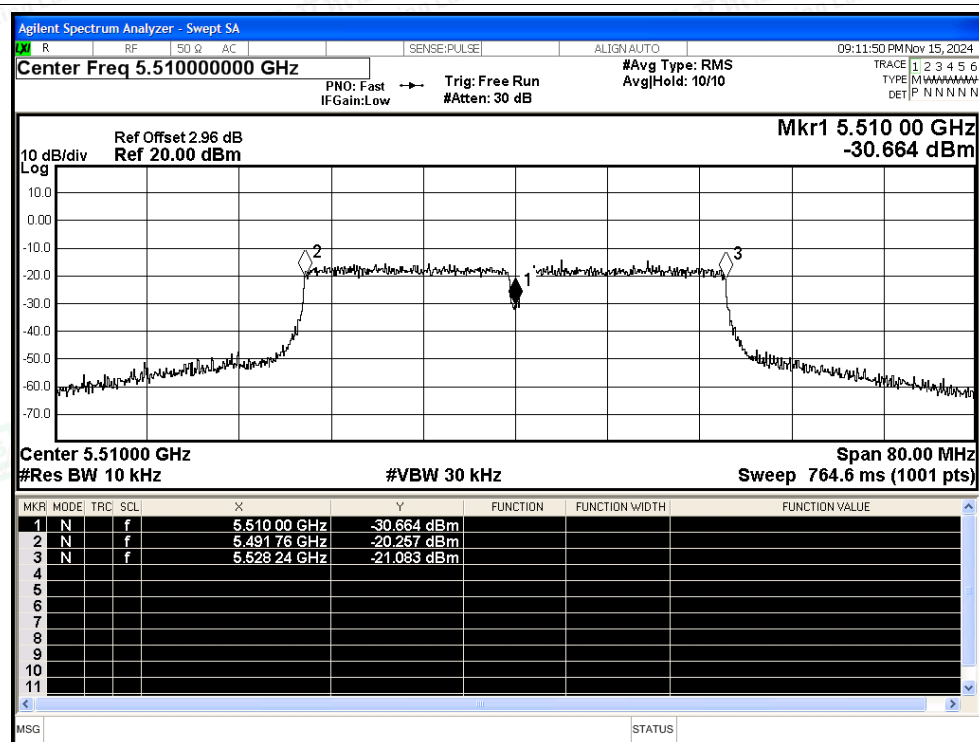

Freq. Stability NVNT ac40 5550MHz Ant4

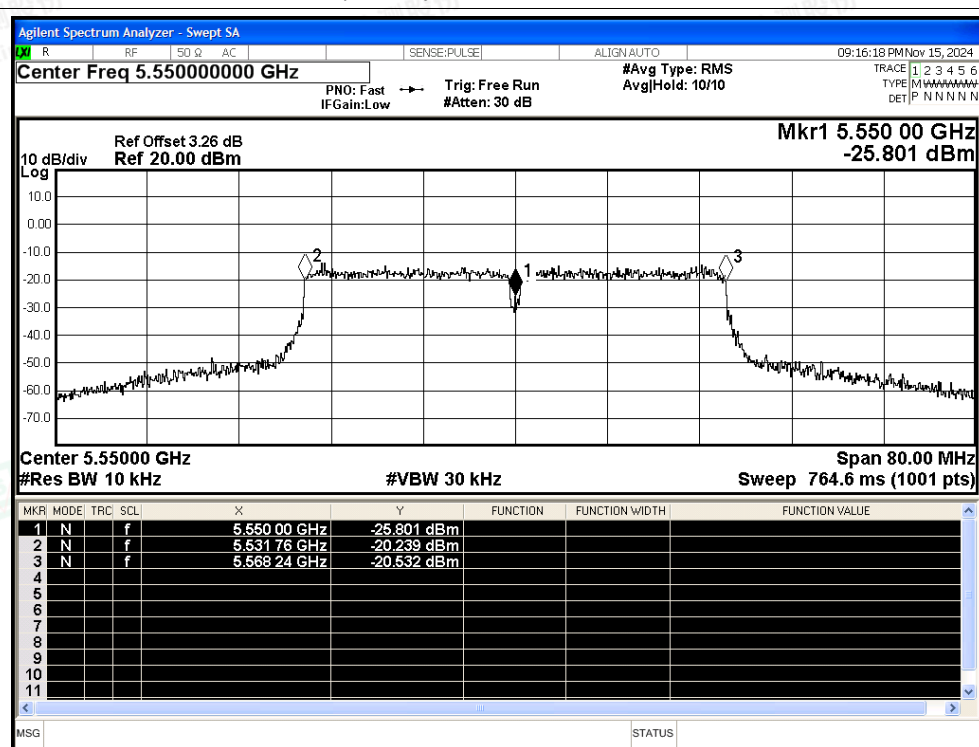

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5670MHz Ant4

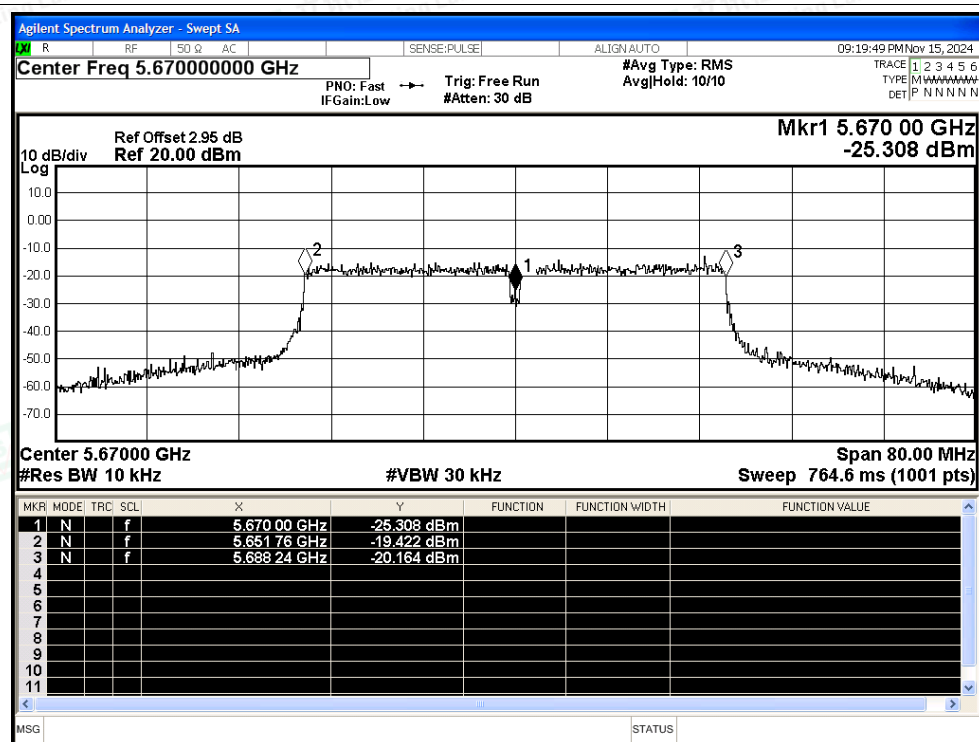

Freq. Stability NVNT ac80 5530MHz Ant4

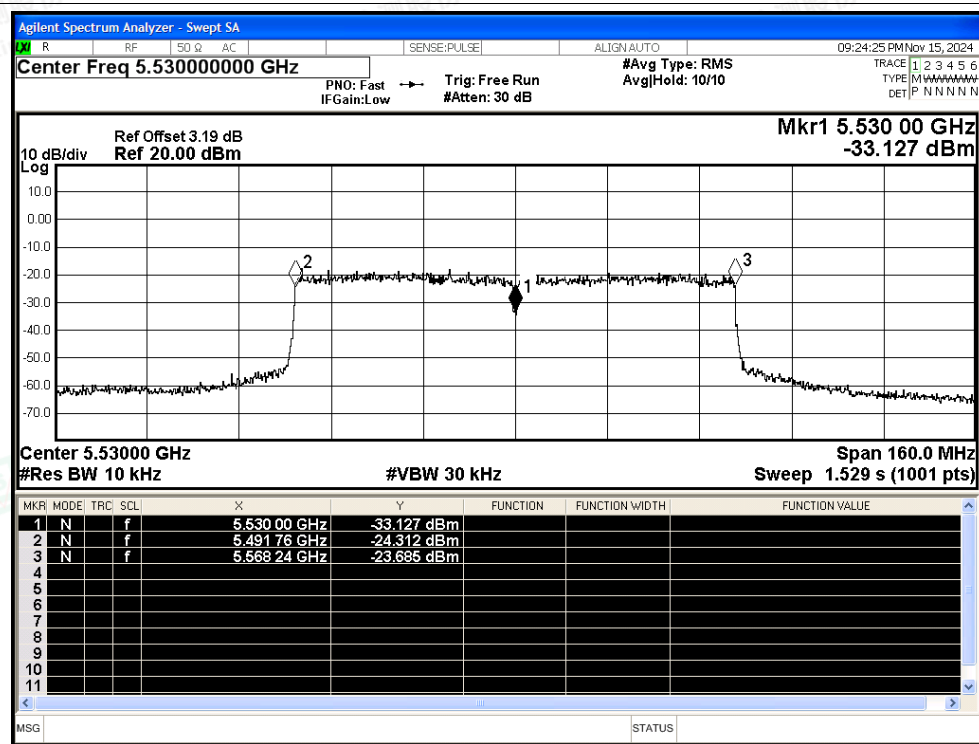

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac80 5610MHz Ant4

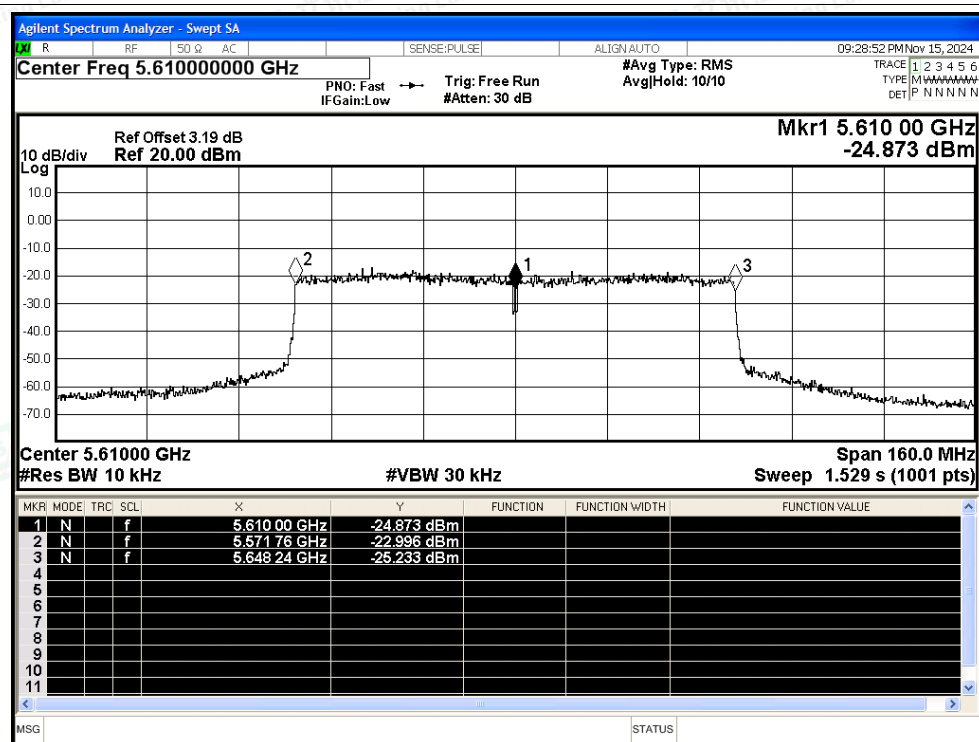

Freq. Stability NVNT ax20 5500MHz Ant4

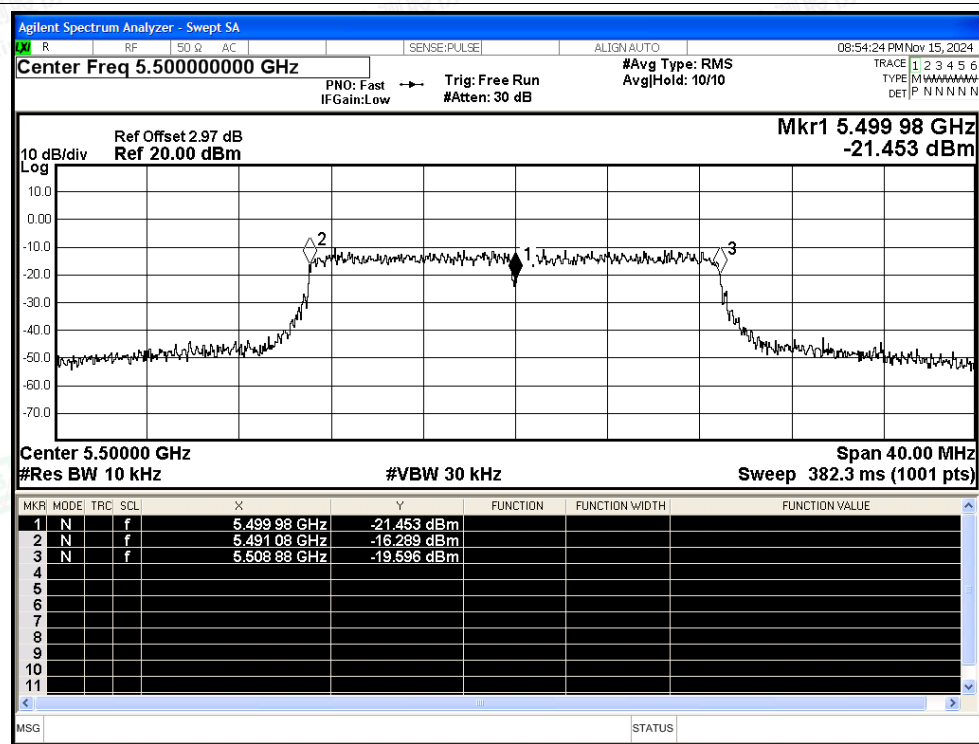

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5580MHz Ant4

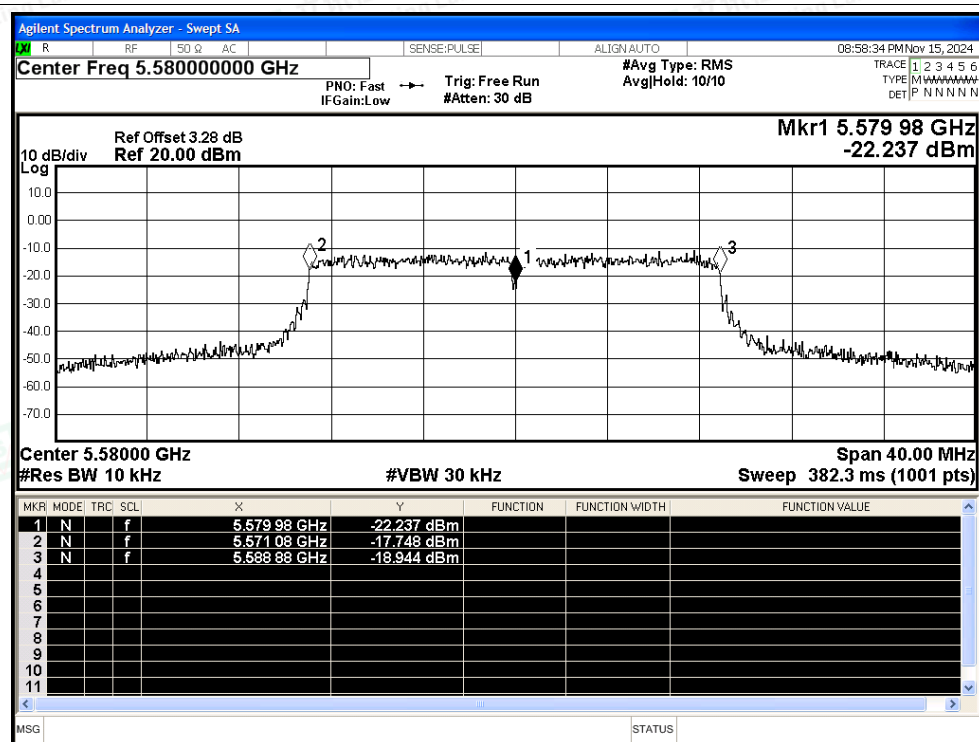

Freq. Stability NVNT ax20 5700MHz Ant4

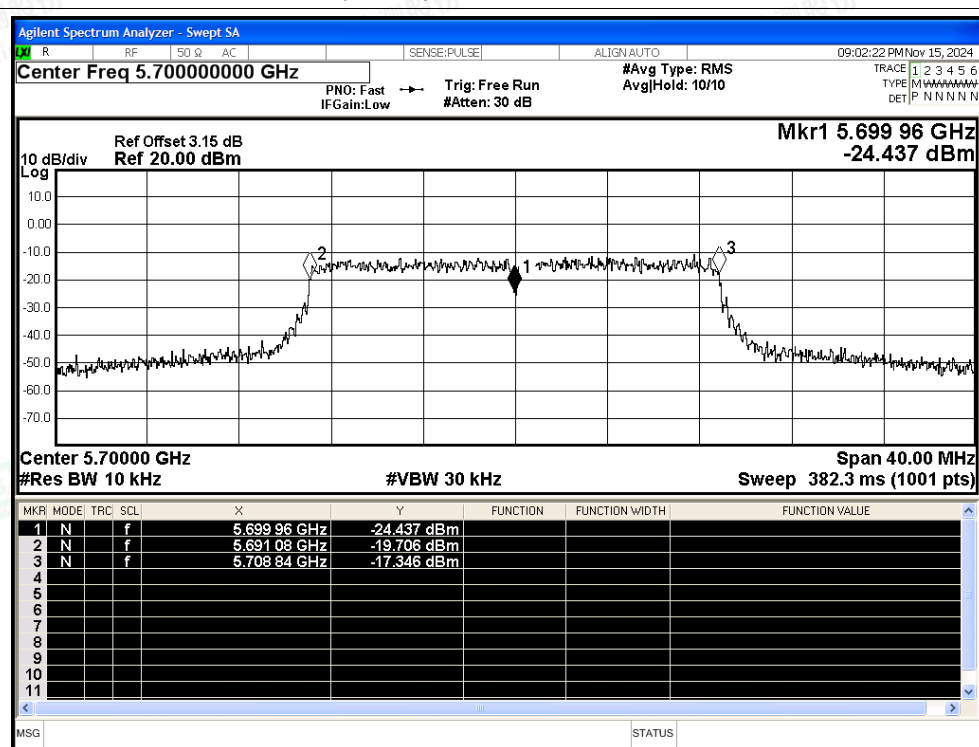

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5510MHz Ant4

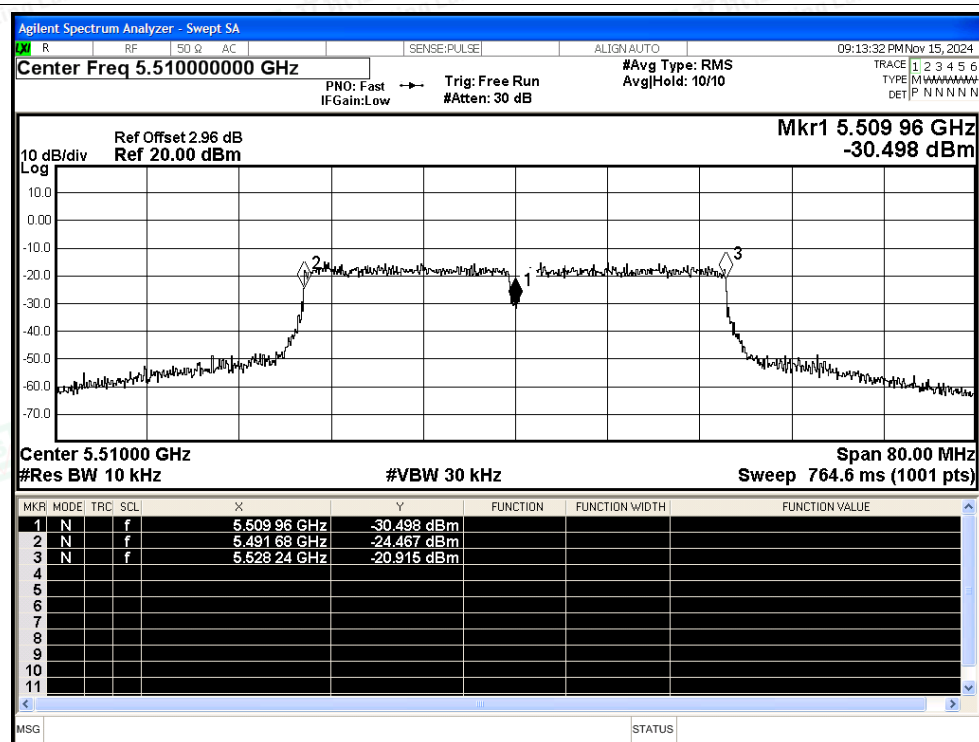

Freq. Stability NVNT ax40 5550MHz Ant4

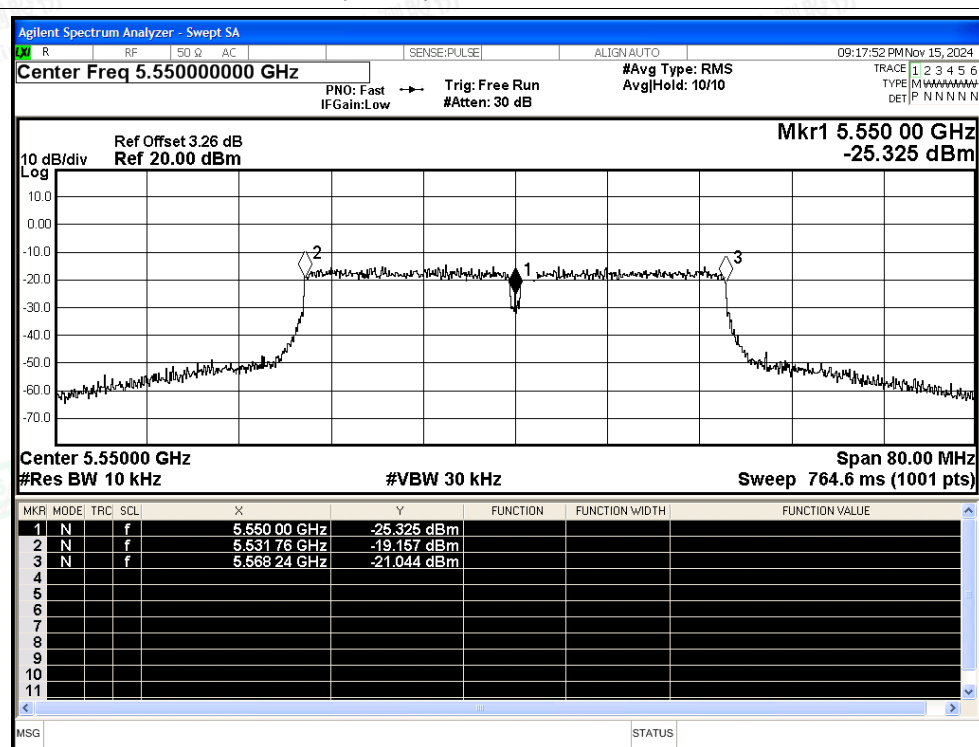

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5670MHz Ant4

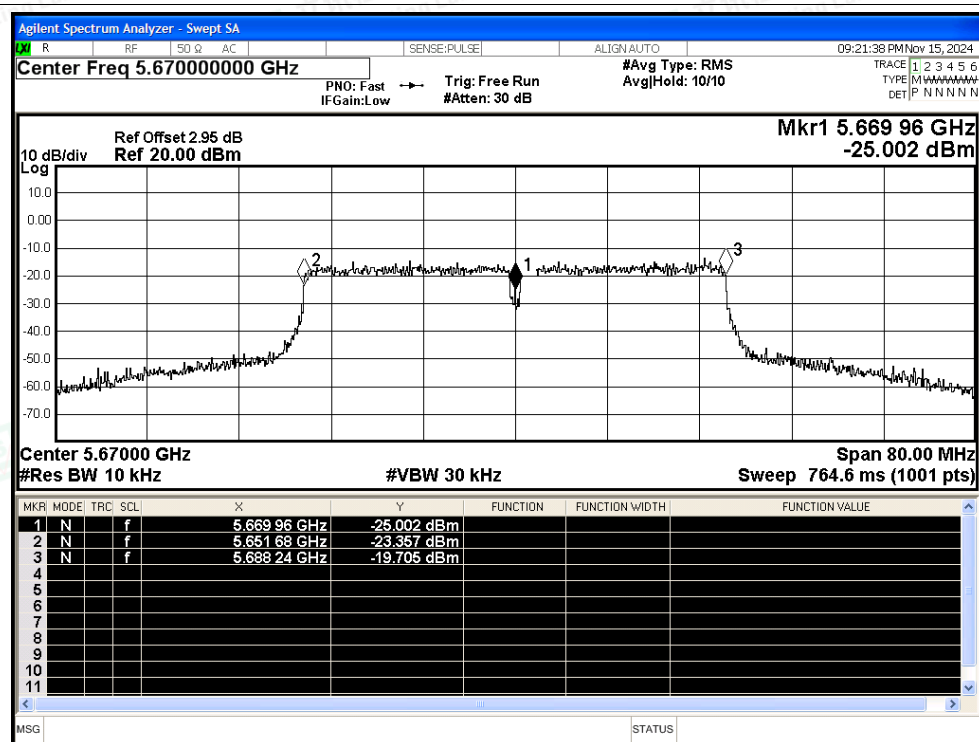

Freq. Stability NVNT ax80 5530MHz Ant4

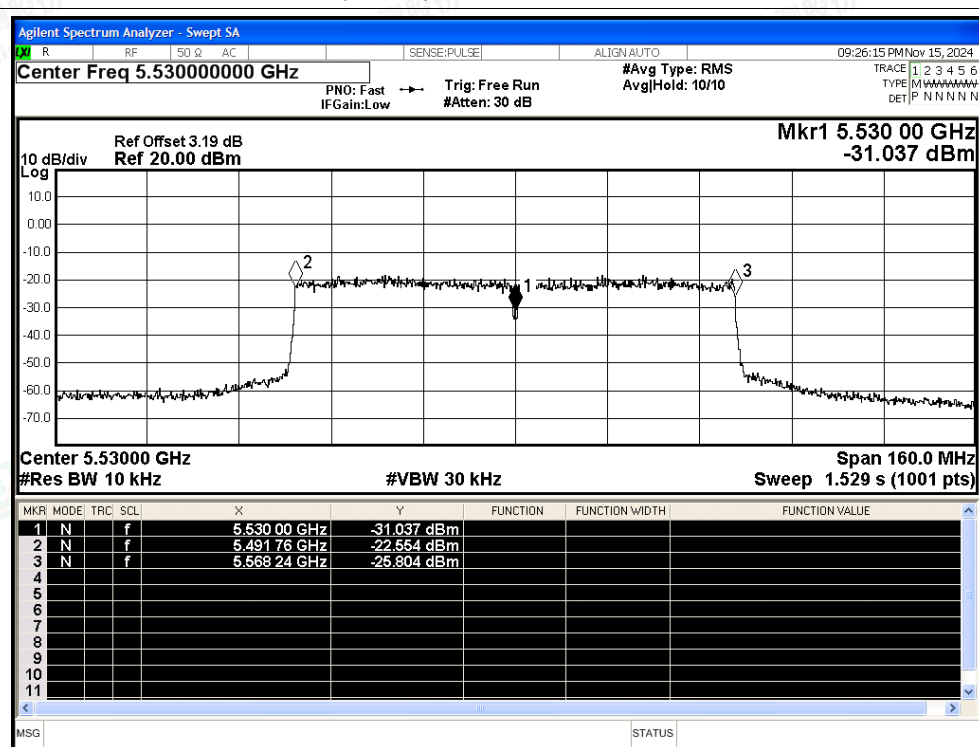

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT ac160 5570MHz Ant4

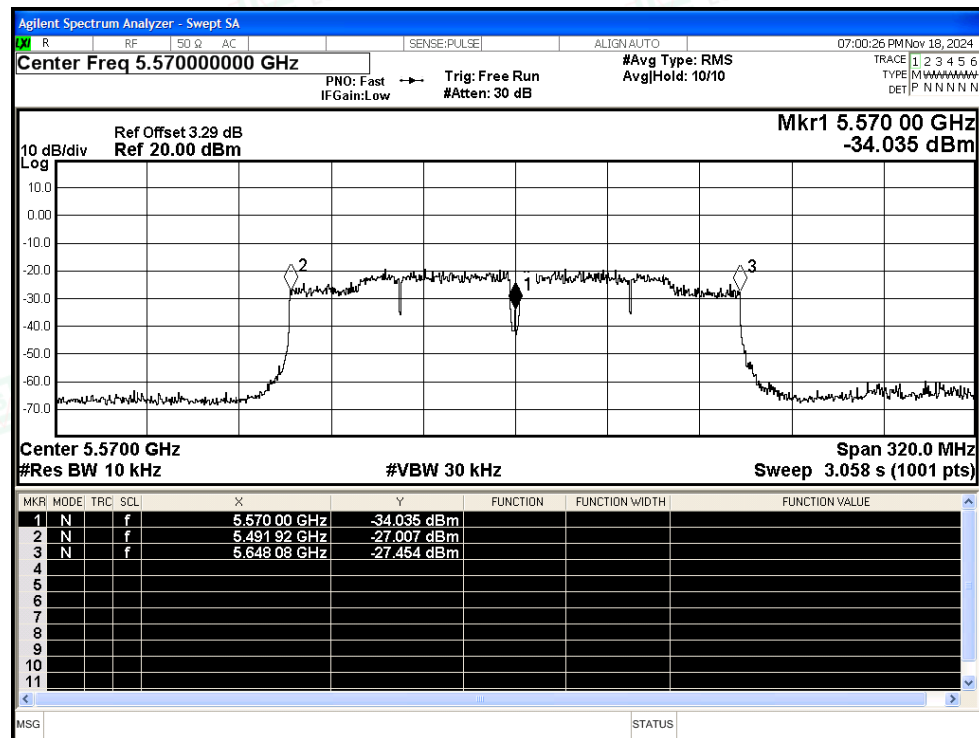

Freq. Stability NVNT ax160 5570MHz Ant4

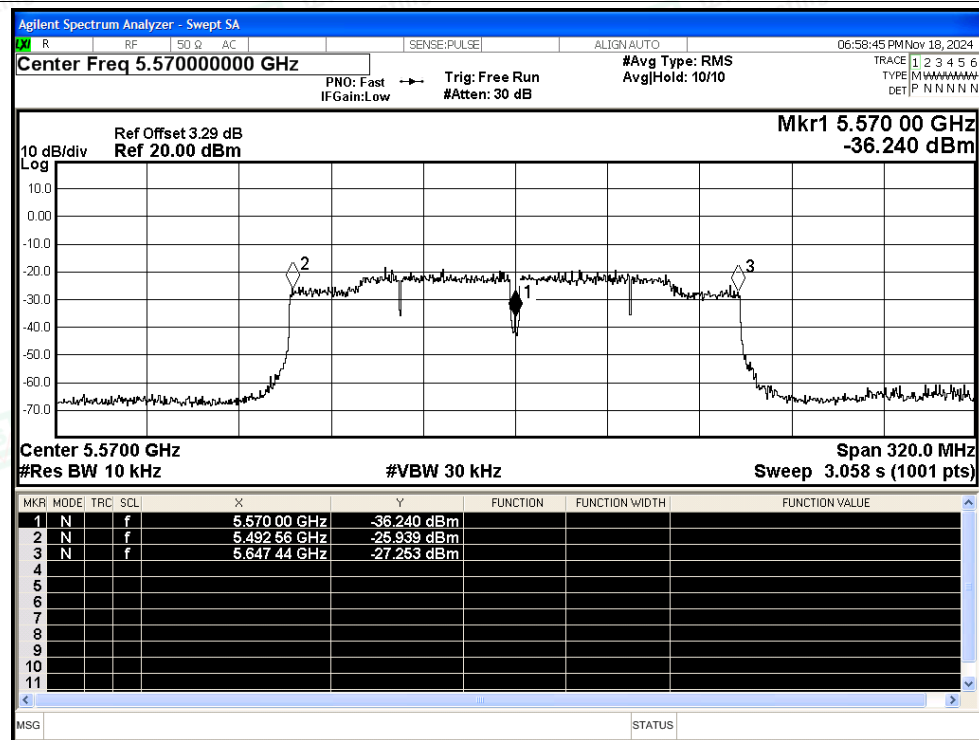

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant3	94.65	0.24	0.91
NVNT	a	5580	Ant3	94.65	0.24	0.91
NVNT	a	5700	Ant3	94.56	0.24	0.91
NVNT	n20	5500	Ant3	97.29	0.12	0.44
NVNT	n20	5580	Ant3	97.25	0.12	0.44
NVNT	n20	5700	Ant3	97.29	0.12	0.44
NVNT	n40	5510	Ant3	97.27	0.12	0.46
NVNT	n40	5550	Ant3	97.18	0.12	0.46
NVNT	n40	5670	Ant3	97.18	0.12	0.46
NVNT	ac20	5500	Ant3	97.34	0.12	0.44
NVNT	ac20	5580	Ant3	97.34	0.12	0.44
NVNT	ac20	5700	Ant3	97.34	0.12	0.44
NVNT	ac40	5510	Ant3	97.24	0.12	0.46
NVNT	ac40	5550	Ant3	97.19	0.12	0.46
NVNT	ac40	5670	Ant3	97.24	0.12	0.46
NVNT	ac80	5530	Ant3	94.32	0.25	0.97
NVNT	ac80	5610	Ant3	94.32	0.25	0.97
NVNT	ax20	5500	Ant3	97.34	0.12	0.44
NVNT	ax20	5580	Ant3	97.34	0.12	0.44
NVNT	ax20	5700	Ant3	97.34	0.12	0.44
NVNT	ax40	5510	Ant3	97.19	0.12	0.46
NVNT	ax40	5550	Ant3	97.19	0.12	0.46
NVNT	ax40	5670	Ant3	97.24	0.12	0.46
NVNT	ax80	5530	Ant3	94.41	0.25	0.97
NVNT	ax80	5610	Ant3	94.32	0.25	0.97
NVNT	ac160	5570	Ant3	77.83	1.09	6.06
NVNT	ax160	5570	Ant3	78.67	1.04	5.65






Test Graphs

Duty Cycle NVNT a 5500MHz Ant3

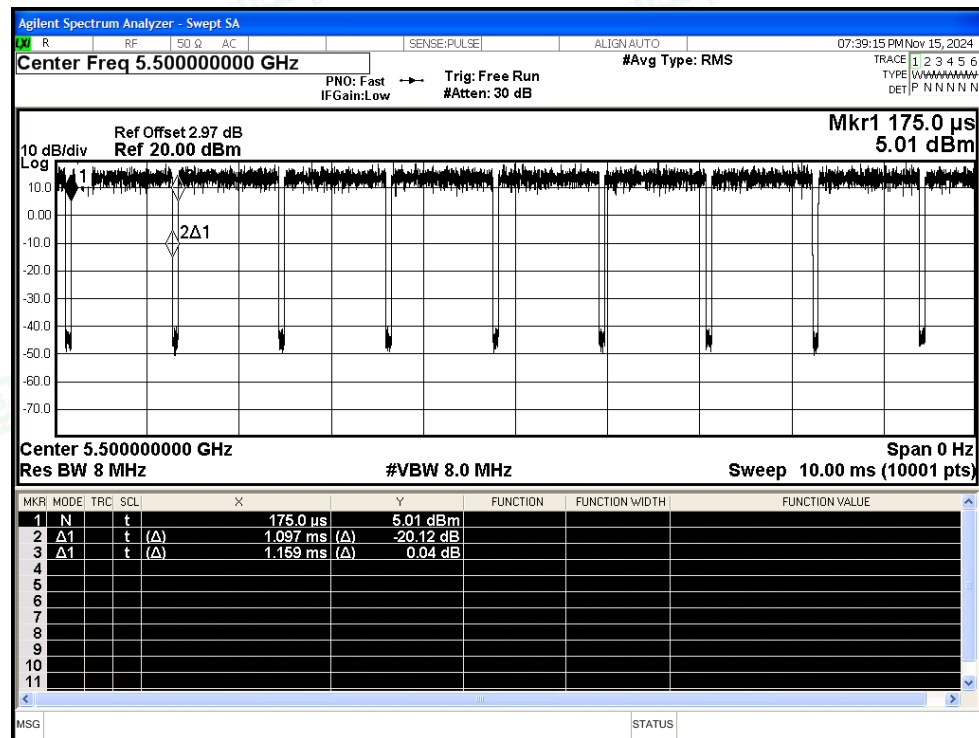

Duty Cycle NVNT a 5580MHz Ant3

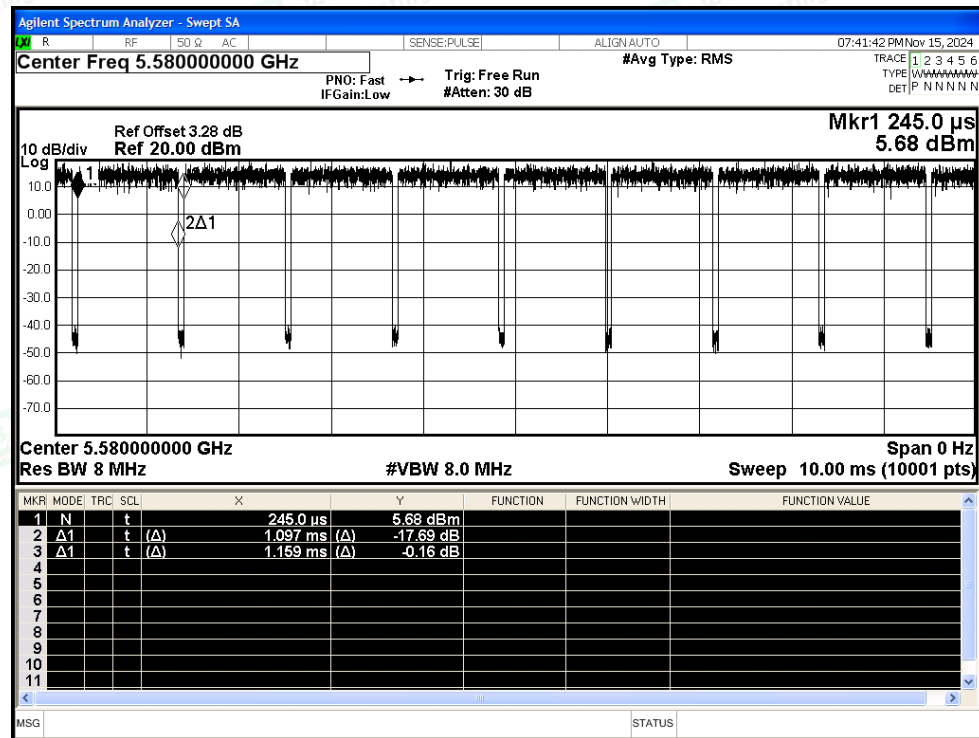

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant3

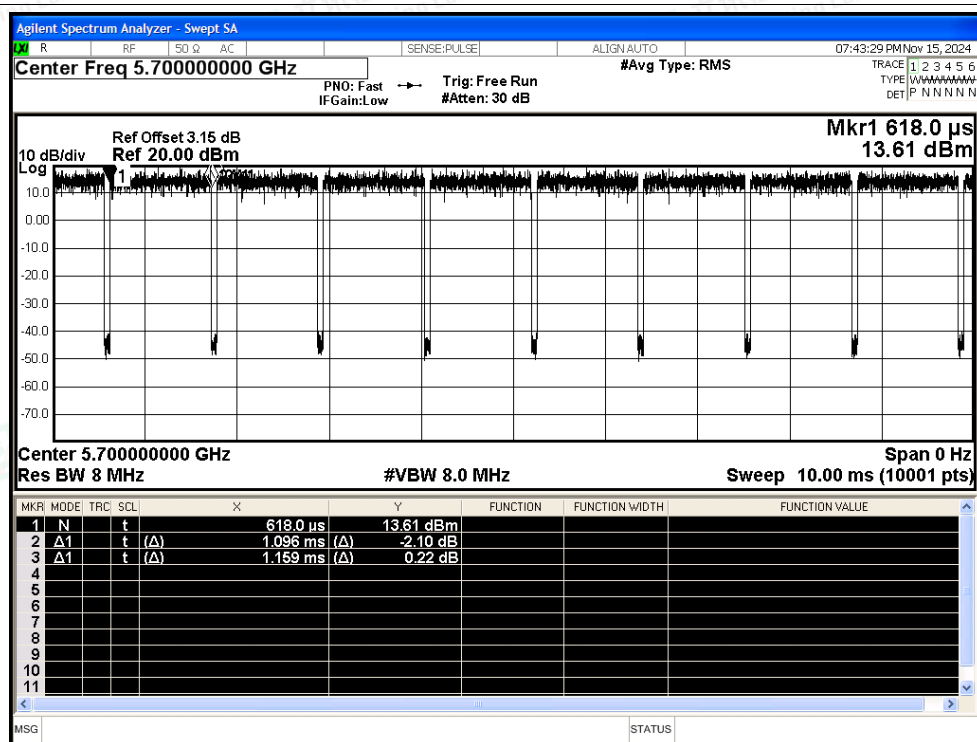

Duty Cycle NVNT n20 5500MHz Ant3

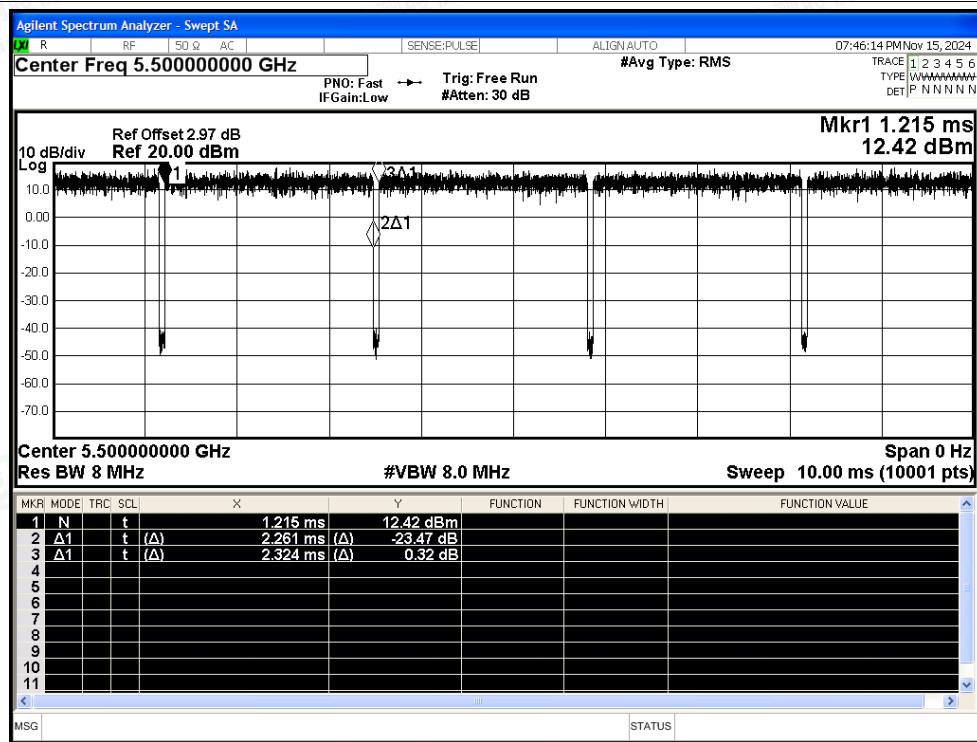

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5580MHz Ant3

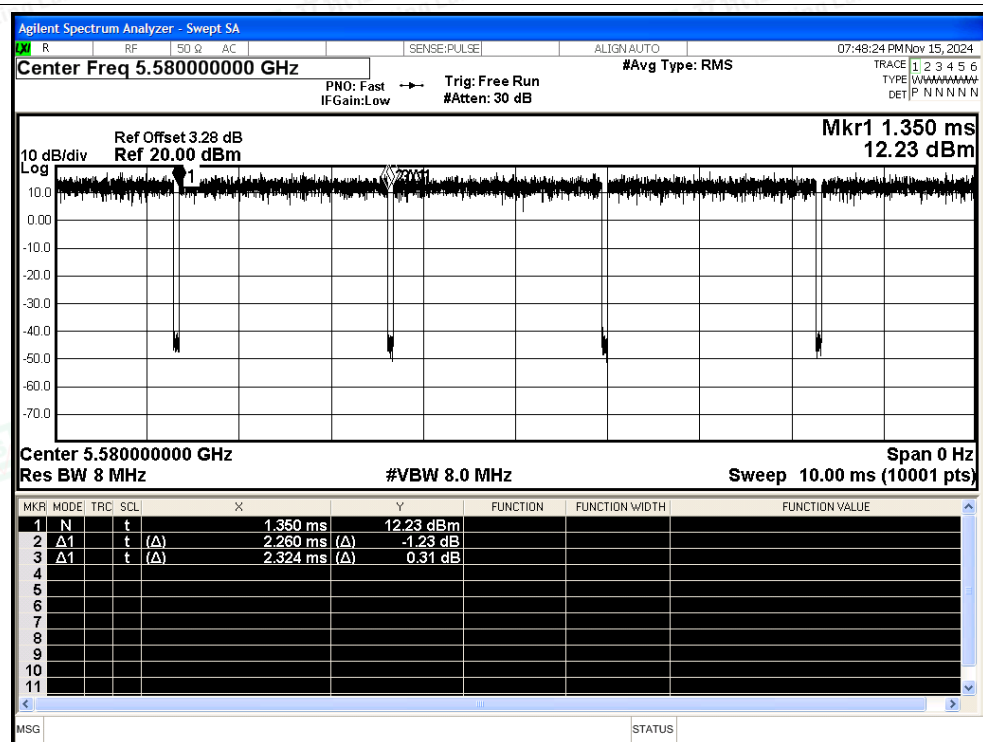


Duty Cycle NVNT n20 5700MHz Ant3

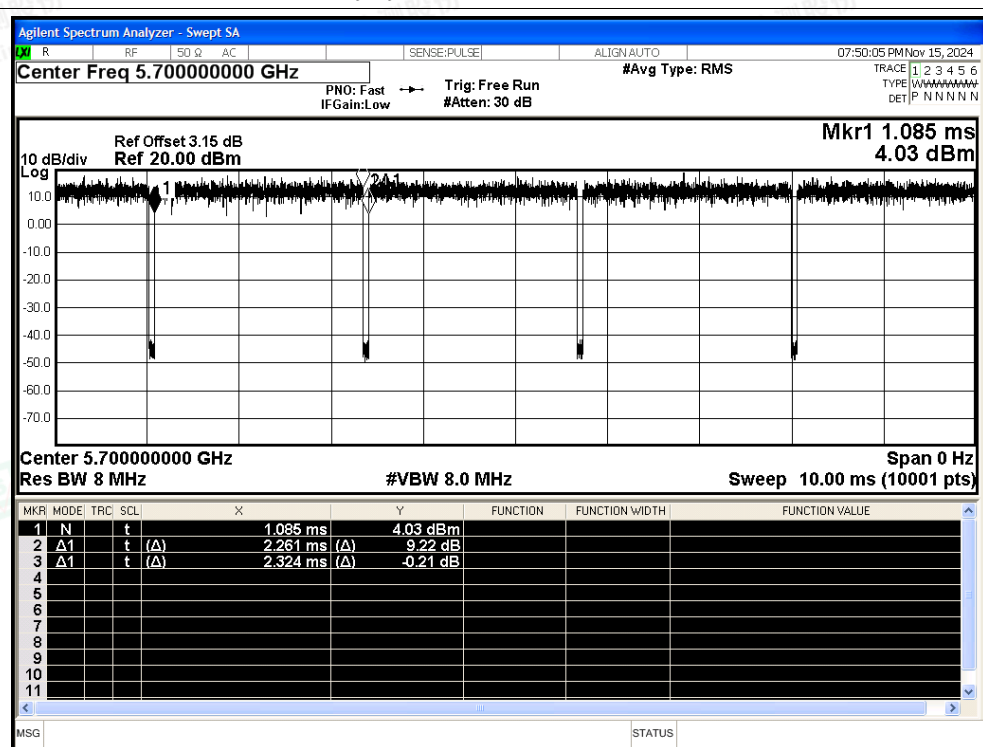




Duty Cycle NVNT n40 5510MHz Ant3

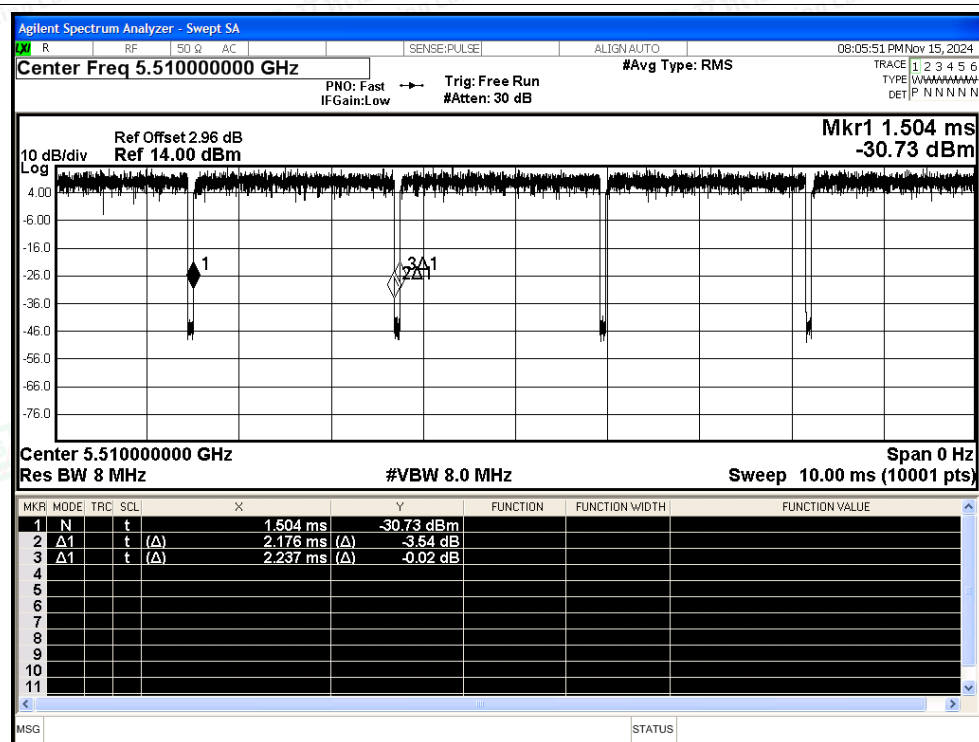


Duty Cycle NVNT n40 5550MHz Ant3

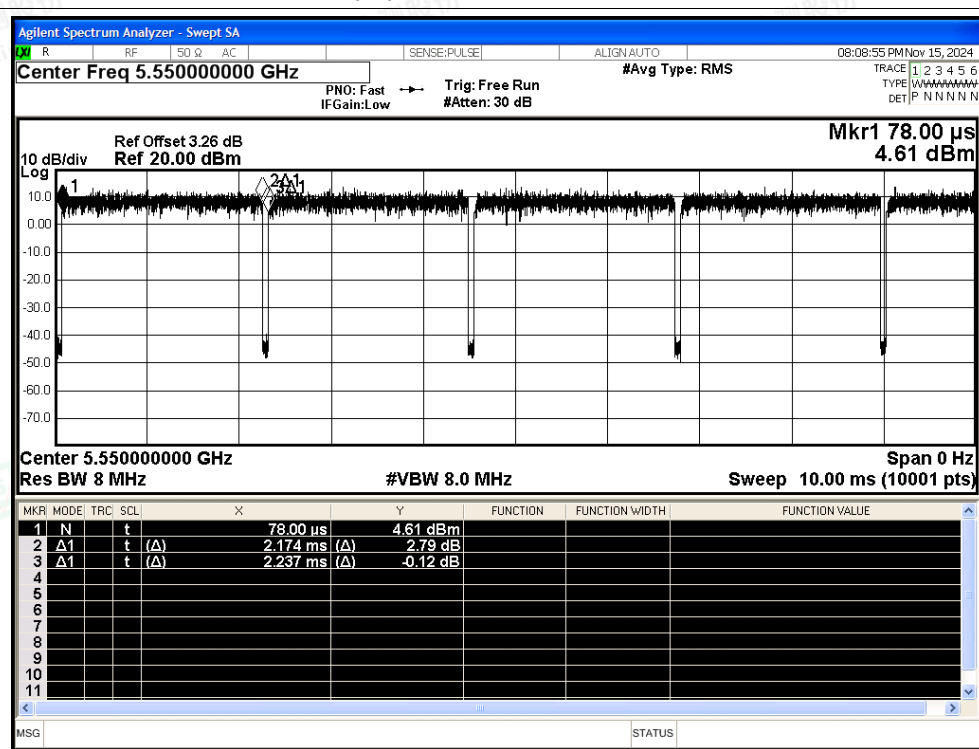




Duty Cycle NVNT n40 5670MHz Ant3

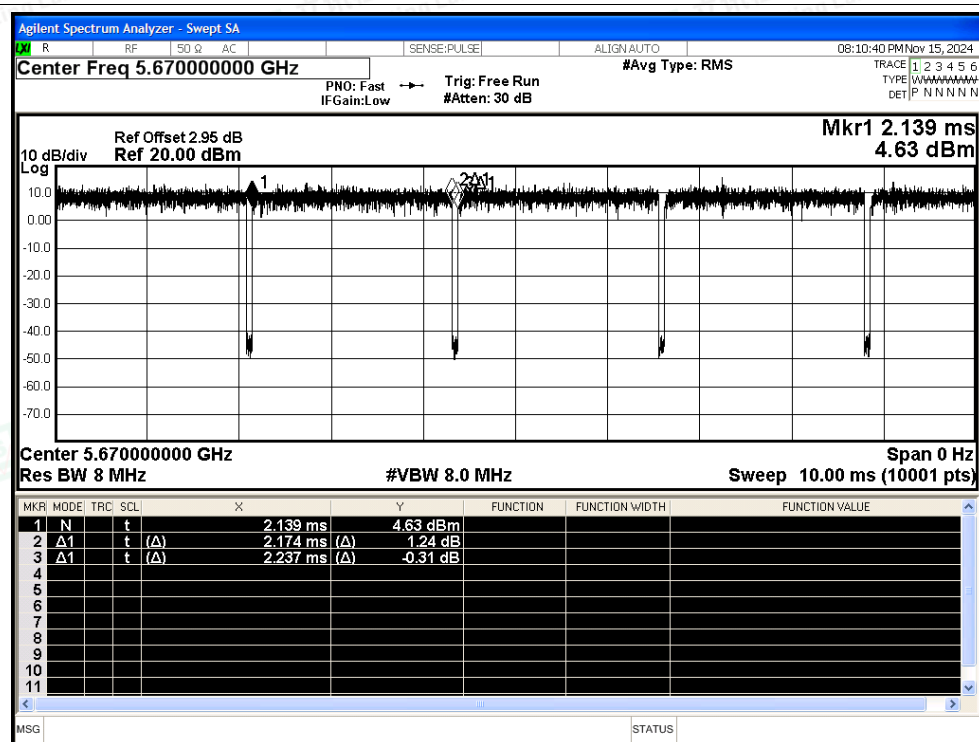

Duty Cycle NVNT ac20 5500MHz Ant3

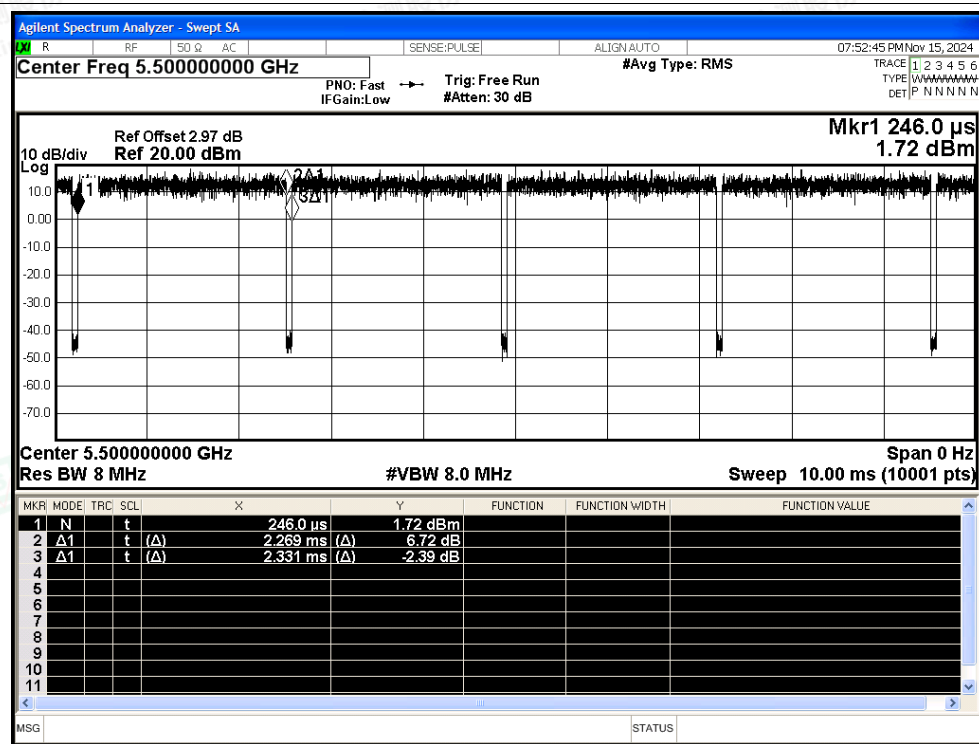

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5580MHz Ant3

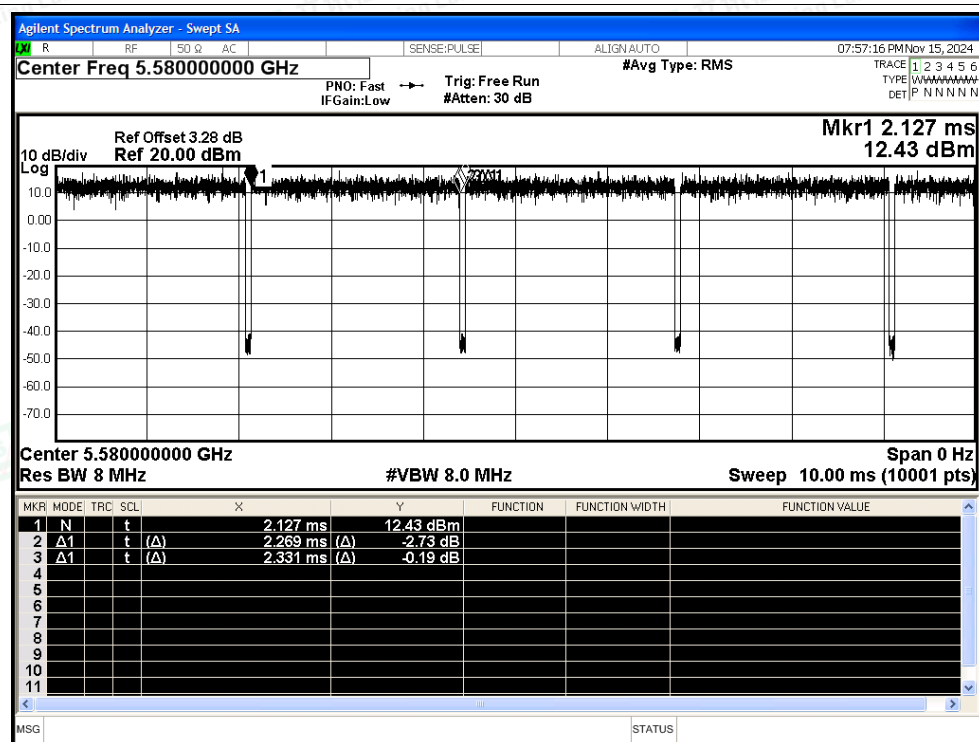


Duty Cycle NVNT ac20 5700MHz Ant3

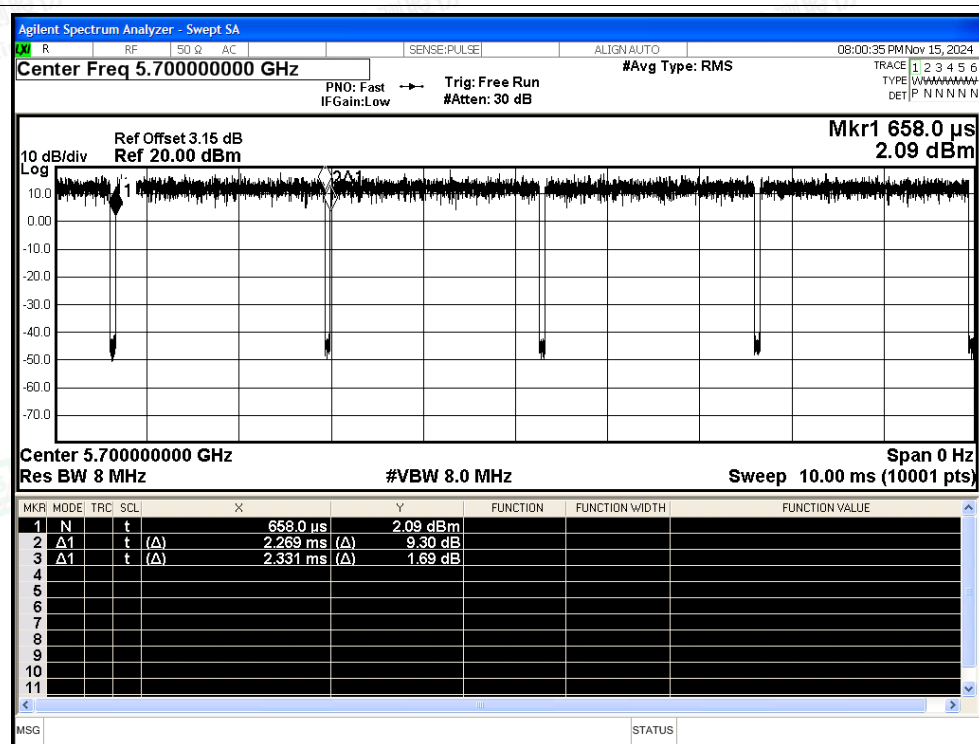




Duty Cycle NVNT ac40 5510MHz Ant3

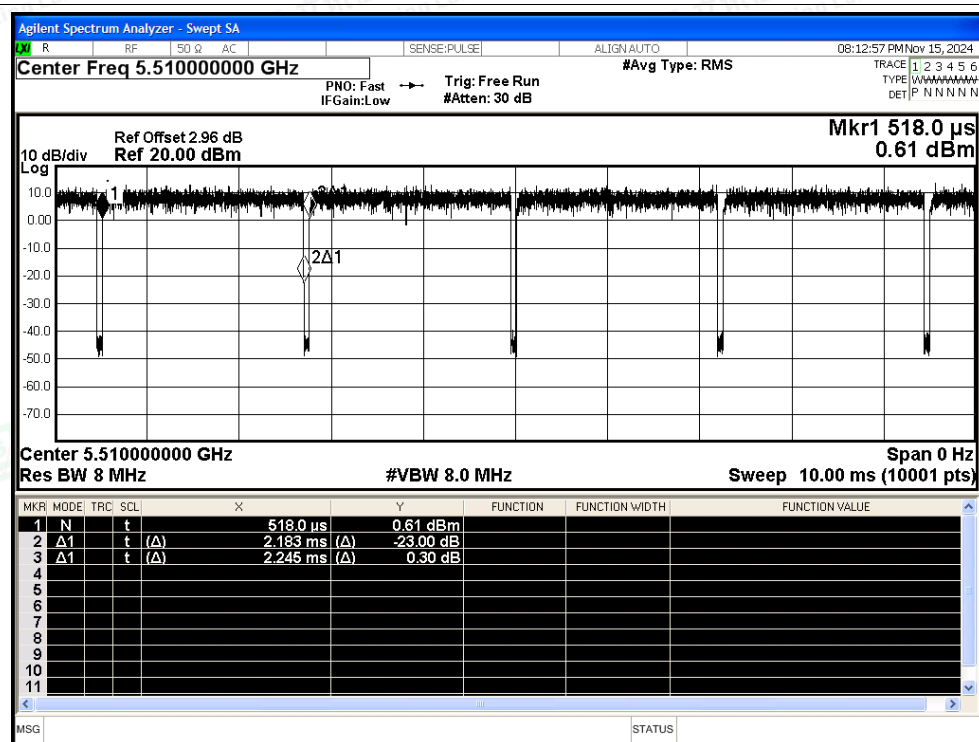

Duty Cycle NVNT ac40 5550MHz Ant3

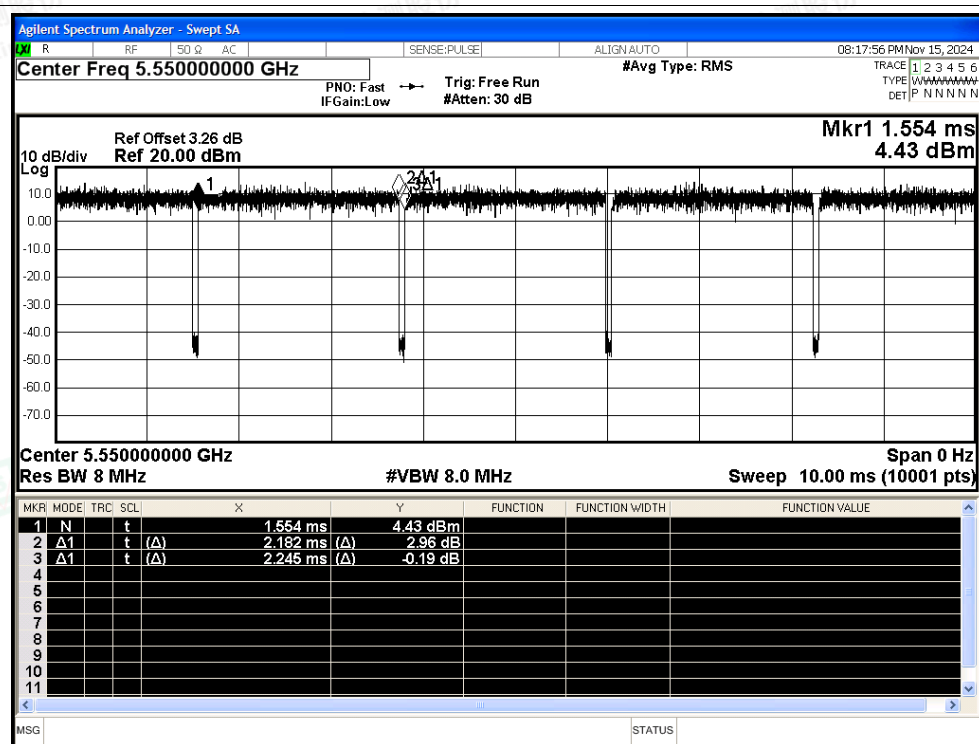

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5670MHz Ant3

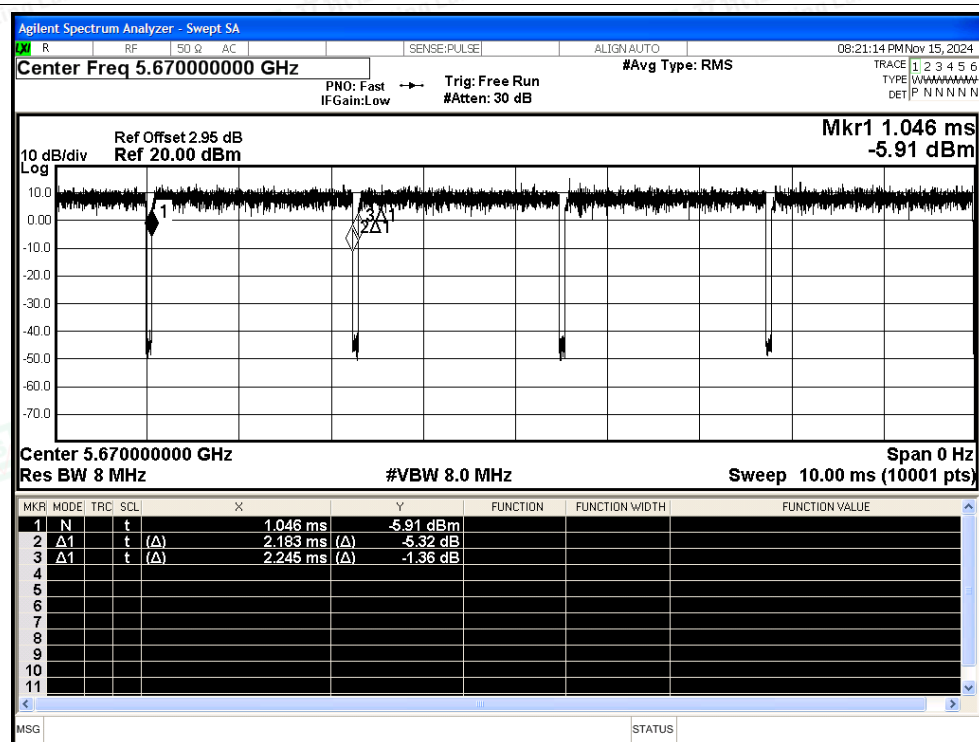

Duty Cycle NVNT ac80 5530MHz Ant3

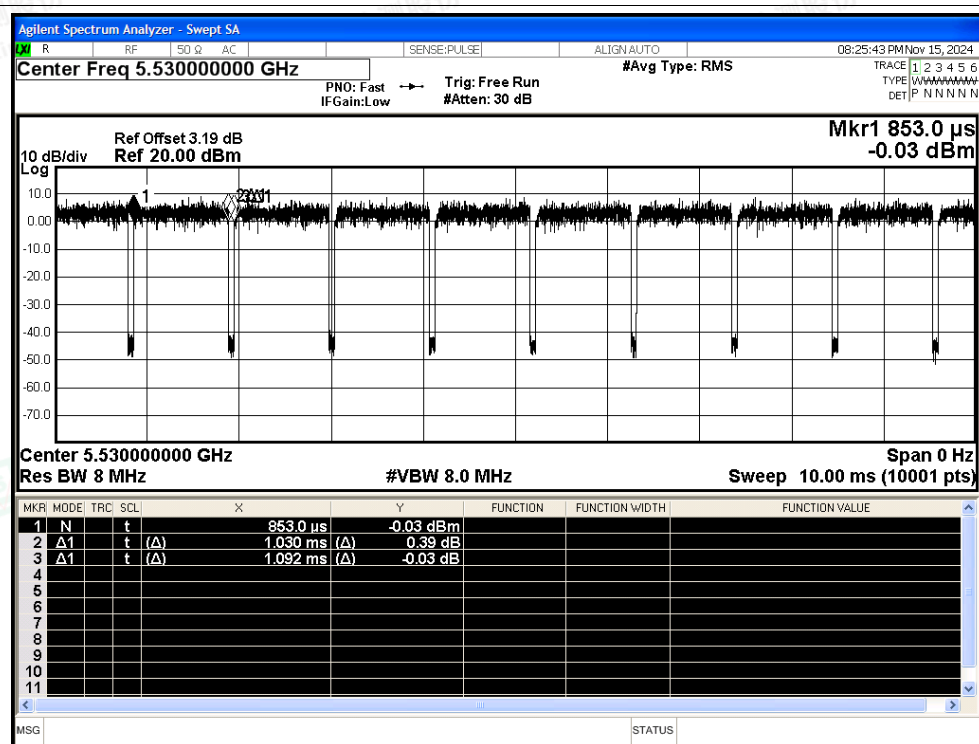

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac80 5610MHz Ant3

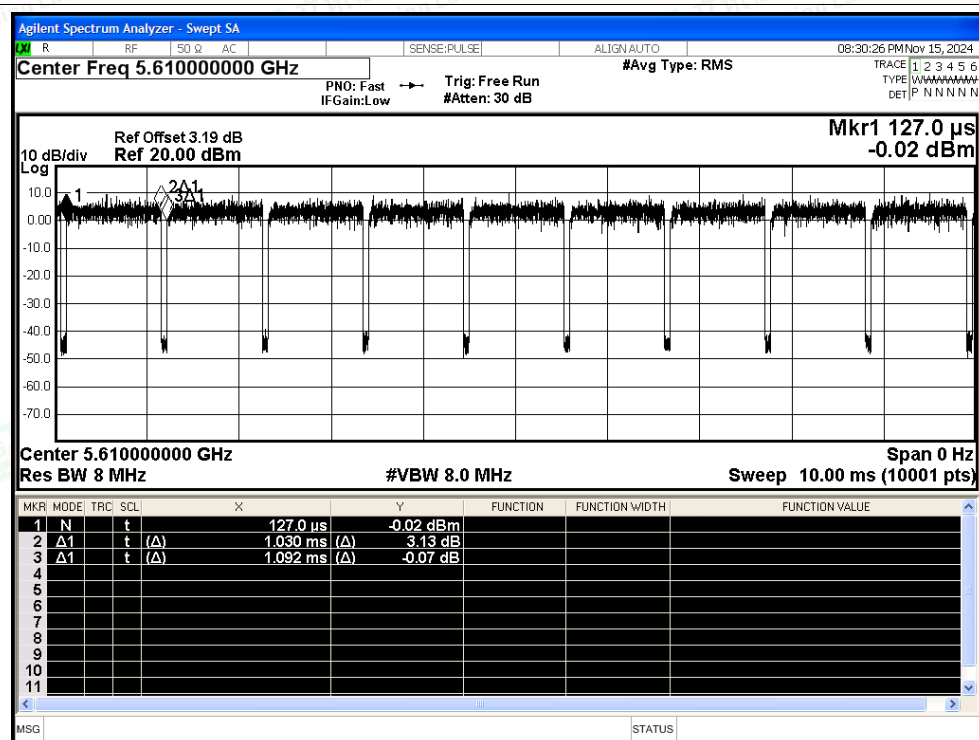


Duty Cycle NVNT ax20 5500MHz Ant3

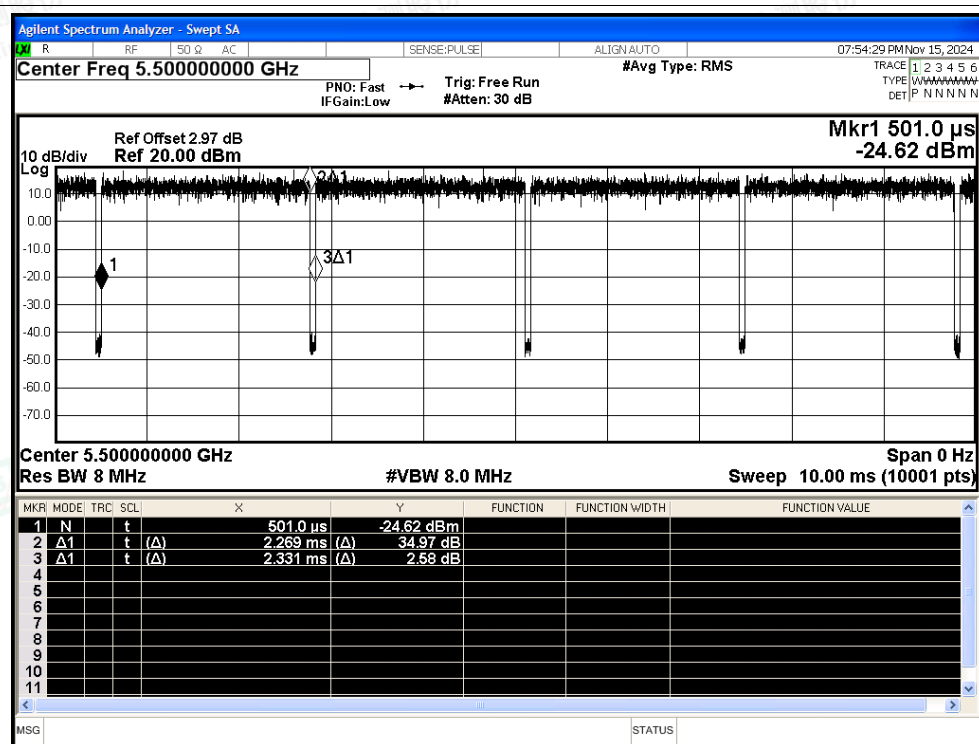




Duty Cycle NVNT ax20 5580MHz Ant3

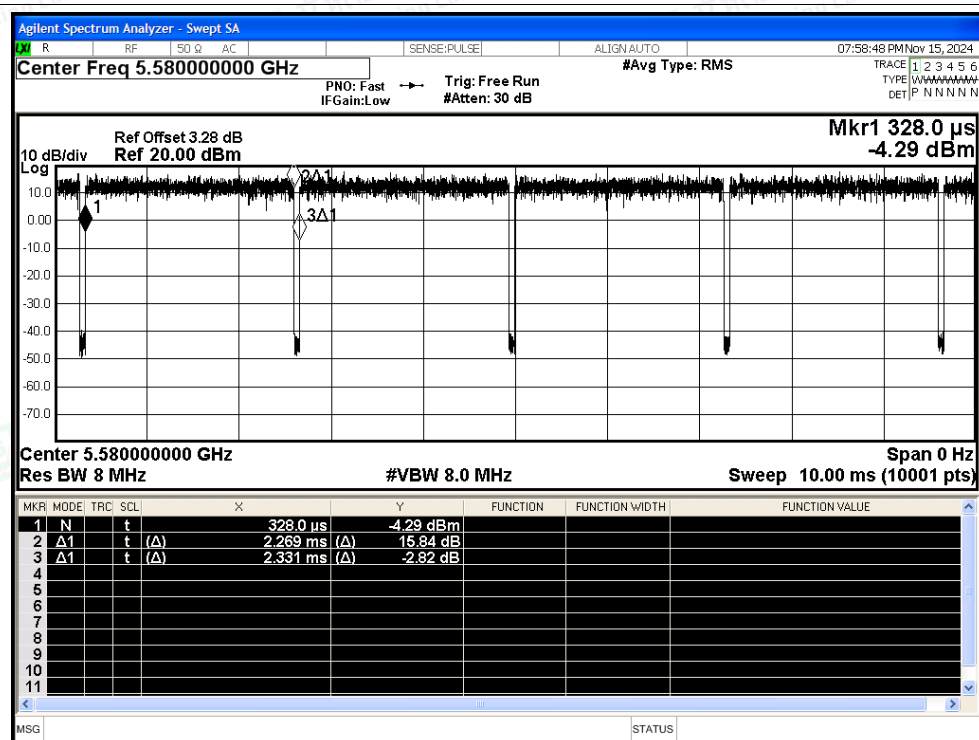


Duty Cycle NVNT ax20 5700MHz Ant3

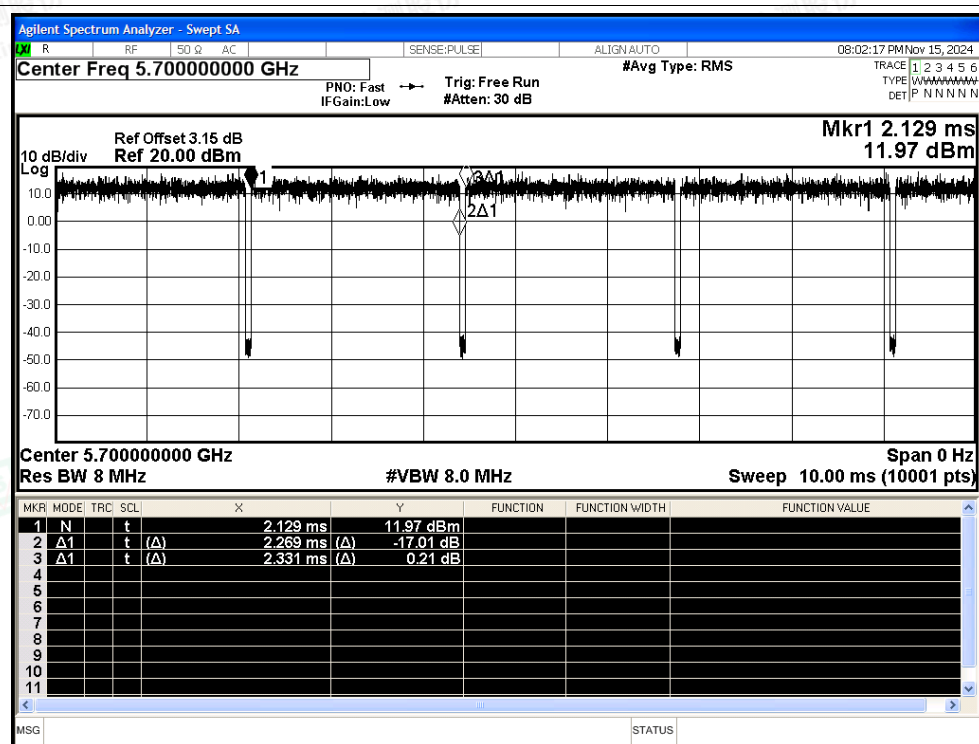




Duty Cycle NVNT ax40 5510MHz Ant3

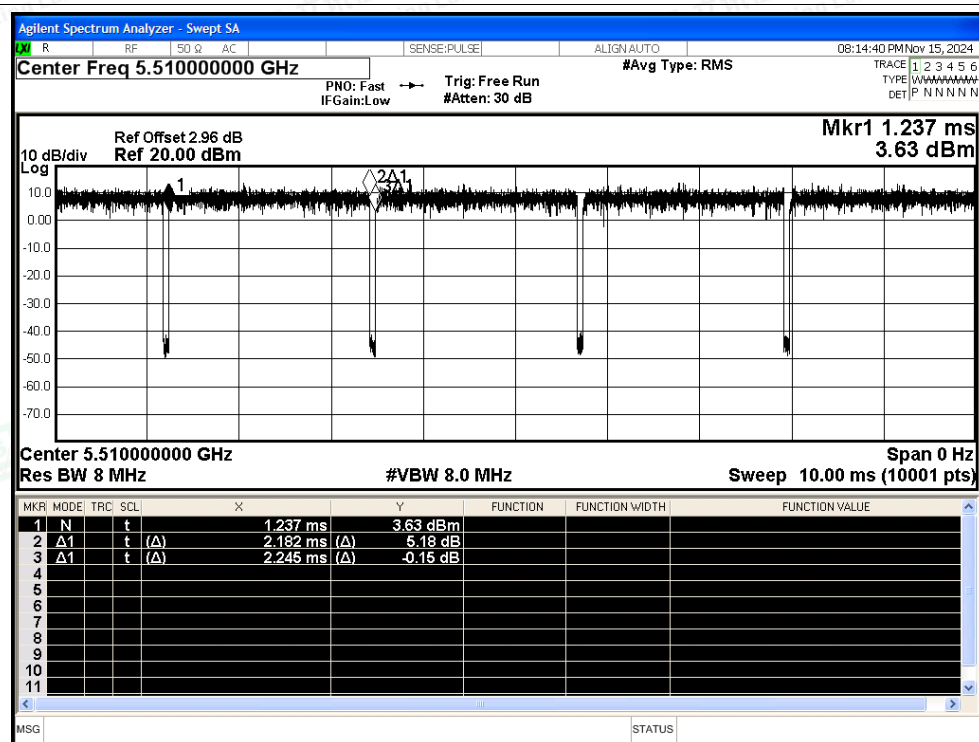


Duty Cycle NVNT ax40 5550MHz Ant3

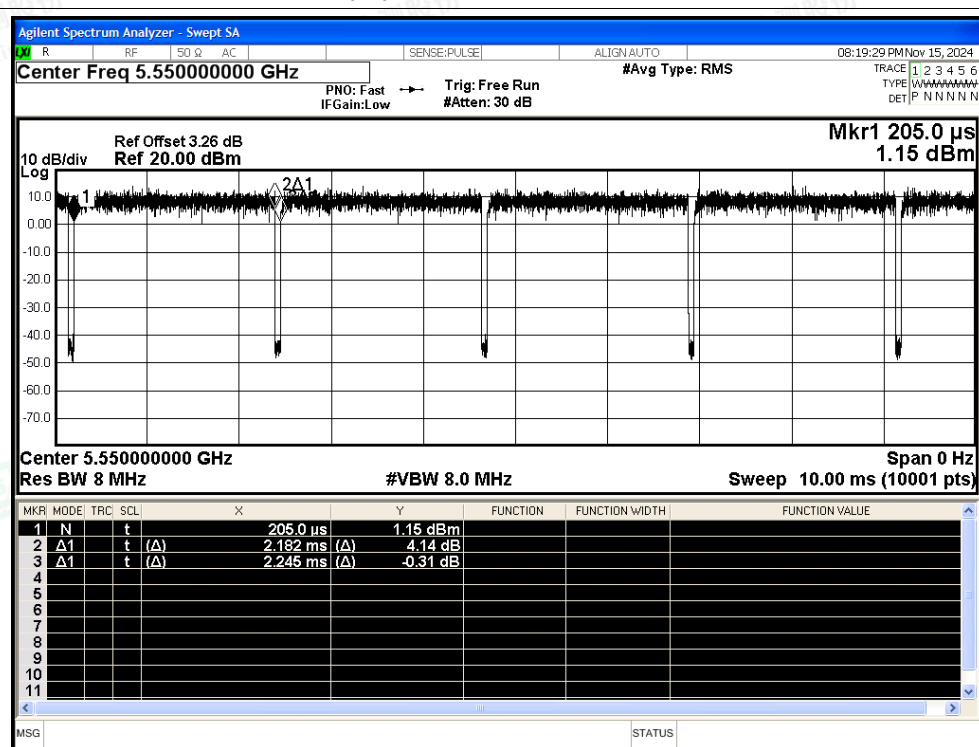




Duty Cycle NVNT ax40 5670MHz Ant3

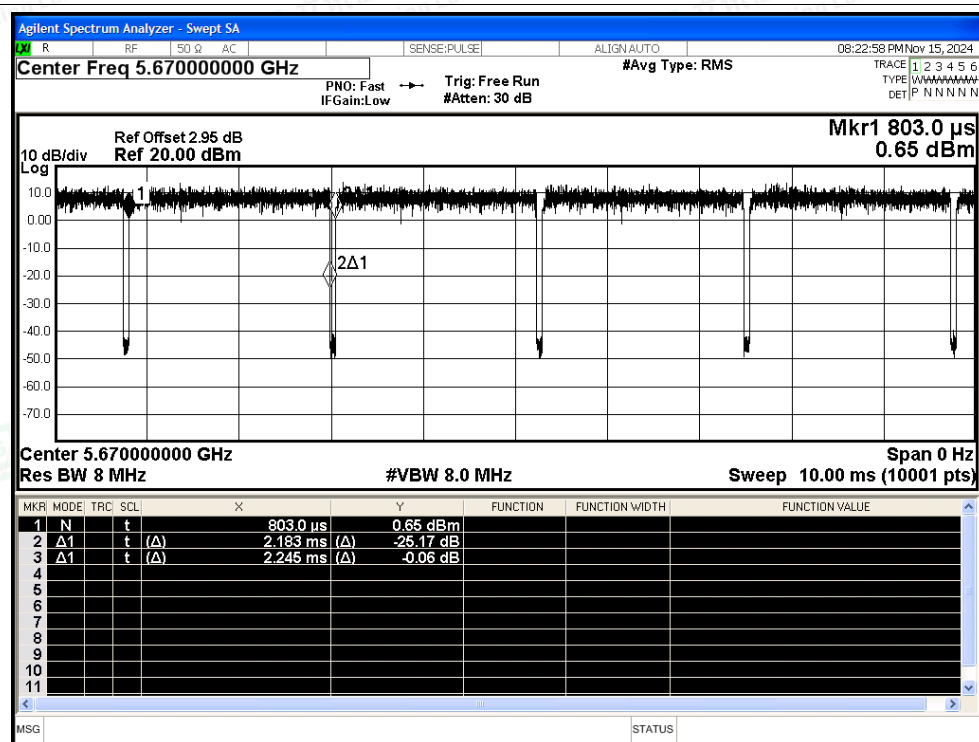

Duty Cycle NVNT ax80 5530MHz Ant3

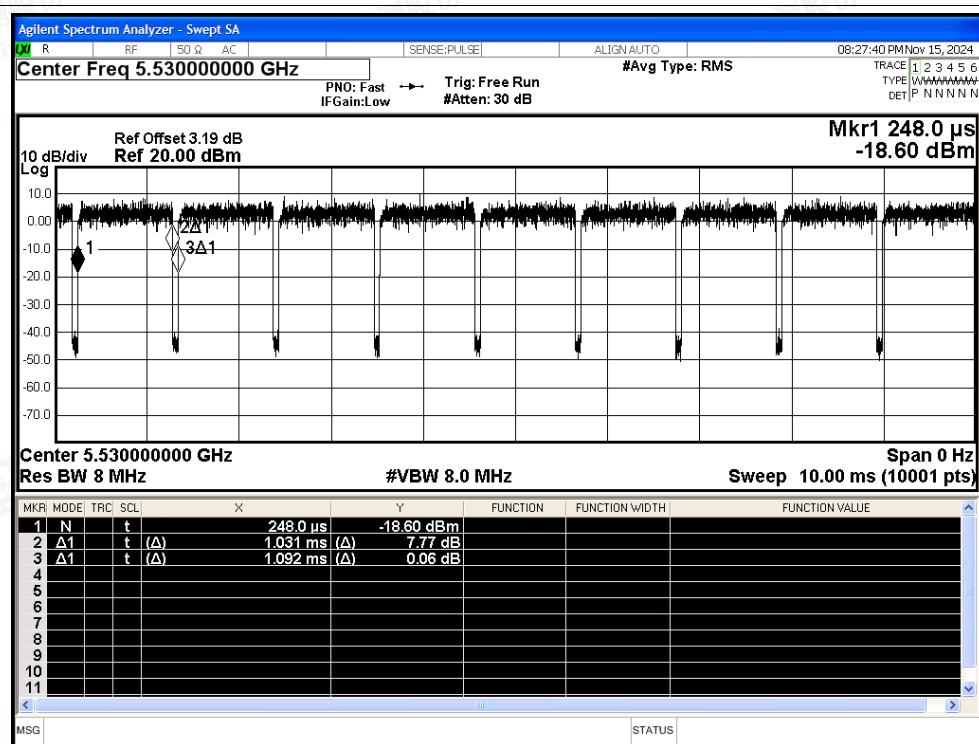


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

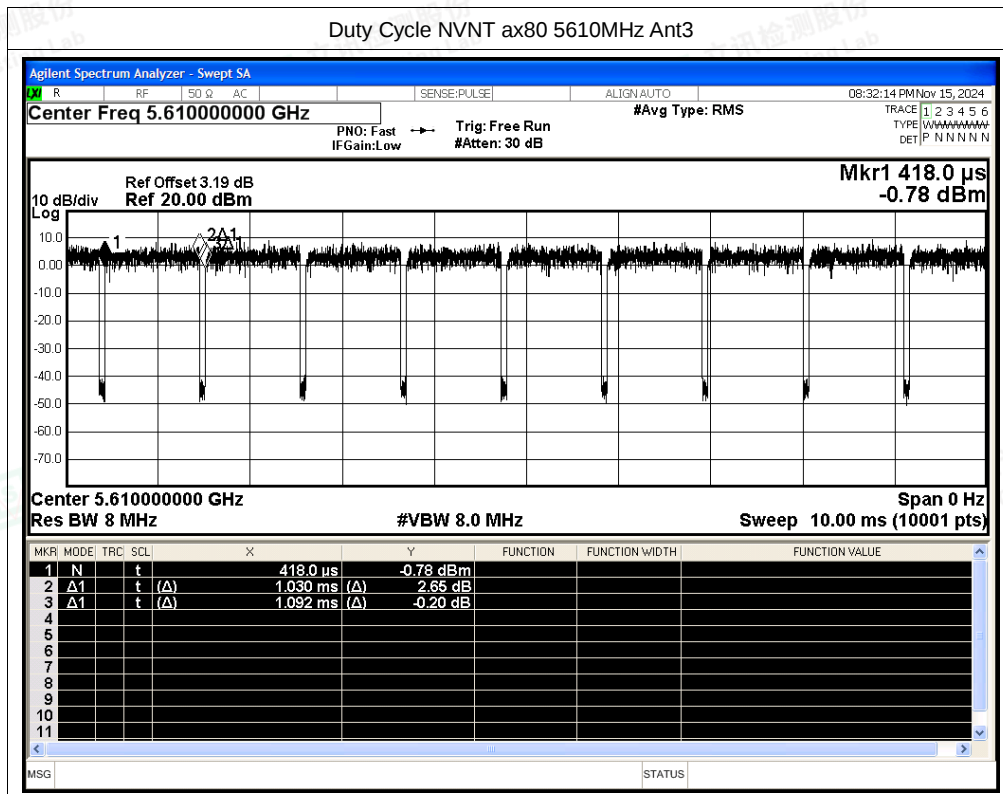




Test Graphs

Duty Cycle NVNT ac160 5570MHz Ant3

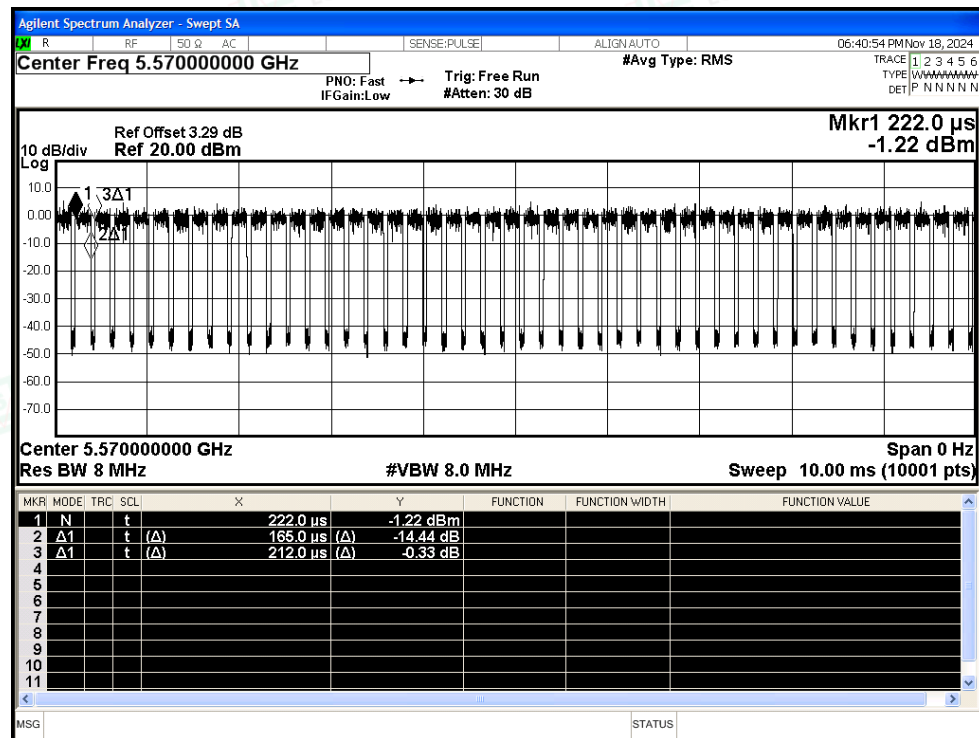

Duty Cycle NVNT ax160 5570MHz Ant3

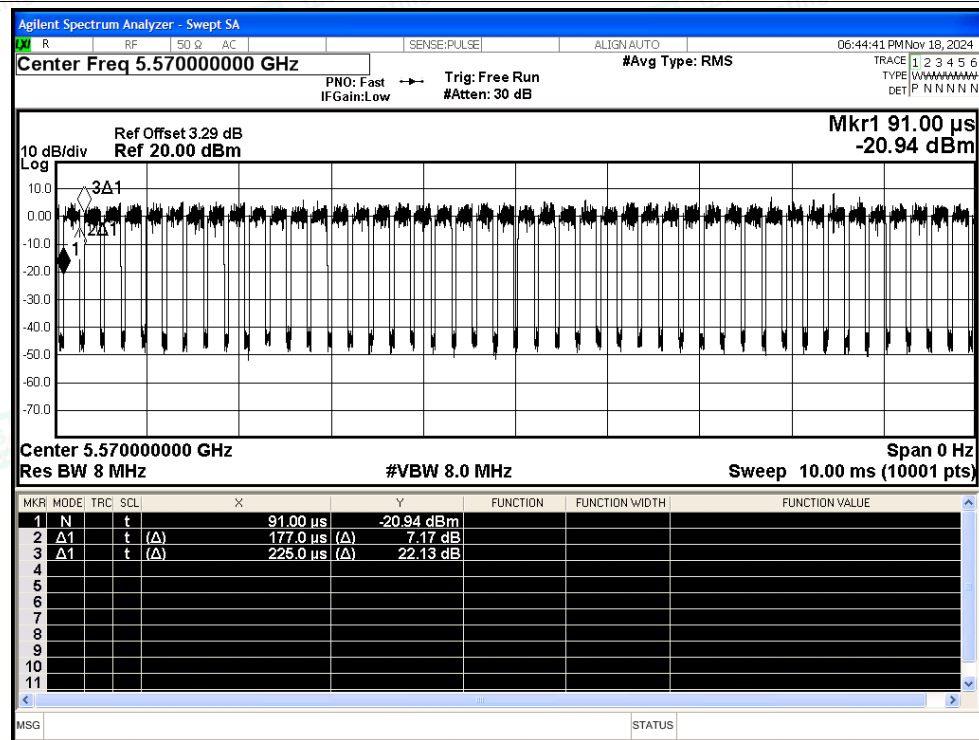

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant4	94.65	0.24	0.91
NVNT	a	5580	Ant4	94.65	0.24	0.91
NVNT	a	5700	Ant4	94.56	0.24	0.91
NVNT	n20	5500	Ant4	97.29	0.12	0.44
NVNT	n20	5580	Ant4	97.29	0.12	0.44
NVNT	n20	5700	Ant4	97.29	0.12	0.44
NVNT	n40	5510	Ant4	97.27	0.12	0.46
NVNT	n40	5550	Ant4	97.23	0.12	0.46
NVNT	n40	5670	Ant4	97.23	0.12	0.46
NVNT	ac20	5500	Ant4	97.3	0.12	0.44
NVNT	ac20	5580	Ant4	97.34	0.12	0.44
NVNT	ac20	5700	Ant4	97.34	0.12	0.44
NVNT	ac40	5510	Ant4	97.19	0.12	0.46
NVNT	ac40	5550	Ant4	97.19	0.12	0.46
NVNT	ac40	5670	Ant4	97.24	0.12	0.46
NVNT	ac80	5530	Ant4	94.32	0.25	0.97
NVNT	ac80	5610	Ant4	94.32	0.25	0.97
NVNT	ax20	5500	Ant4	97.3	0.12	0.44
NVNT	ax20	5580	Ant4	97.34	0.12	0.44
NVNT	ax20	5700	Ant4	97.34	0.12	0.44
NVNT	ax40	5510	Ant4	97.19	0.12	0.46
NVNT	ax40	5550	Ant4	97.24	0.12	0.46
NVNT	ax40	5670	Ant4	97.24	0.12	0.46
NVNT	ax80	5530	Ant4	94.32	0.25	0.97
NVNT	ax80	5610	Ant4	94.32	0.25	0.97
NVNT	ac160	5570	Ant4	77.73	1.09	6.1
NVNT	ax160	5570	Ant4	78.57	1.05	5.68






Test Graphs

Duty Cycle NVNT a 5500MHz Ant4

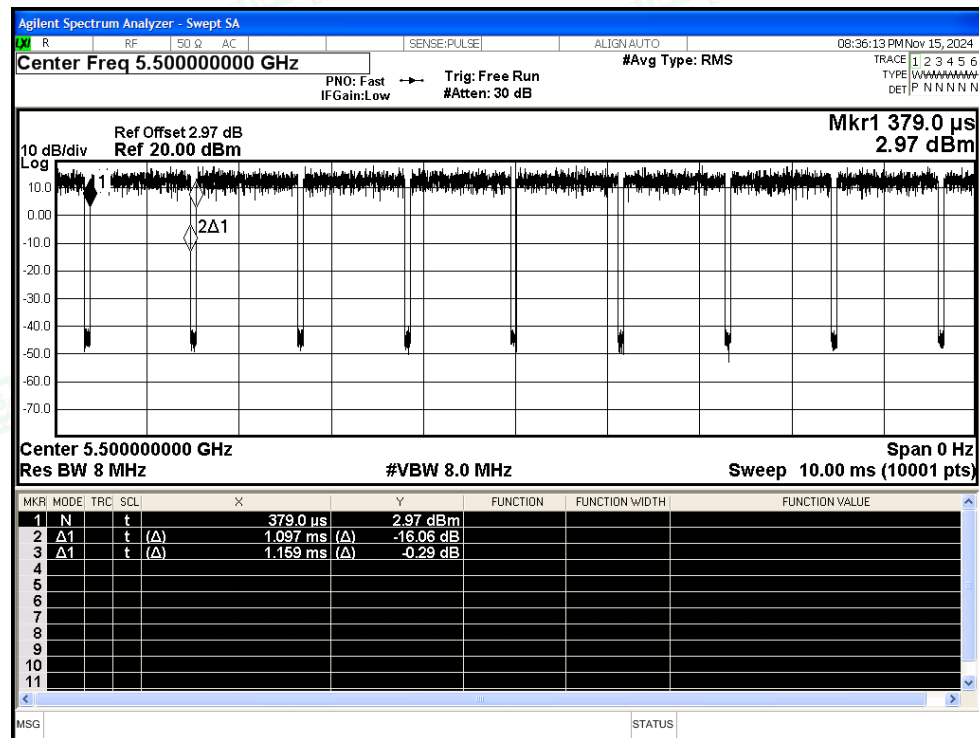

Duty Cycle NVNT a 5580MHz Ant4

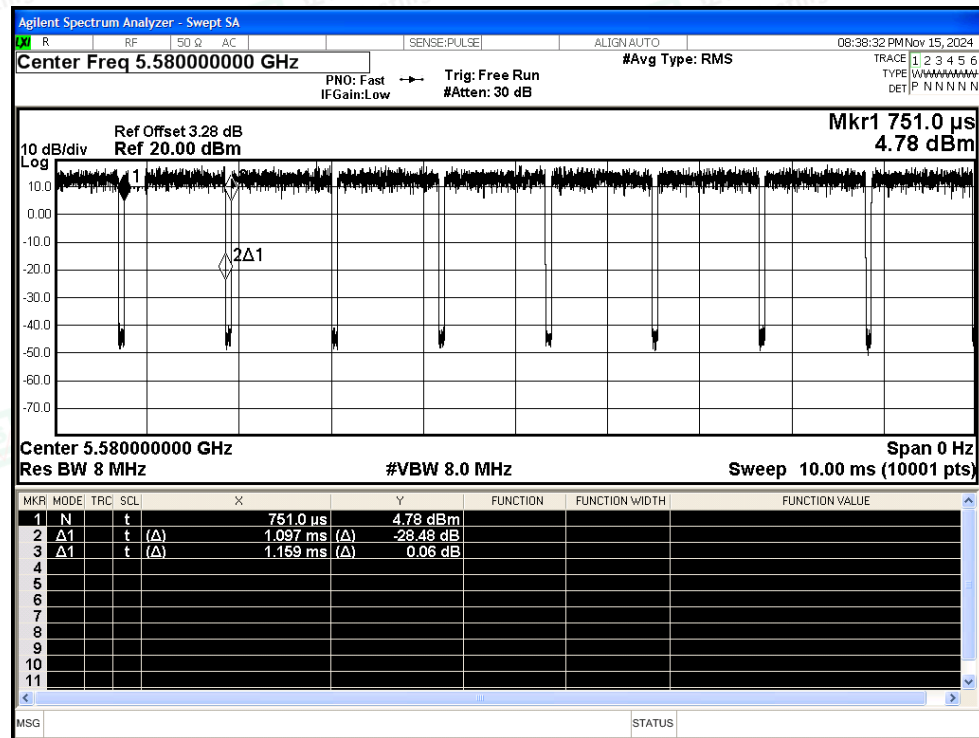

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant4

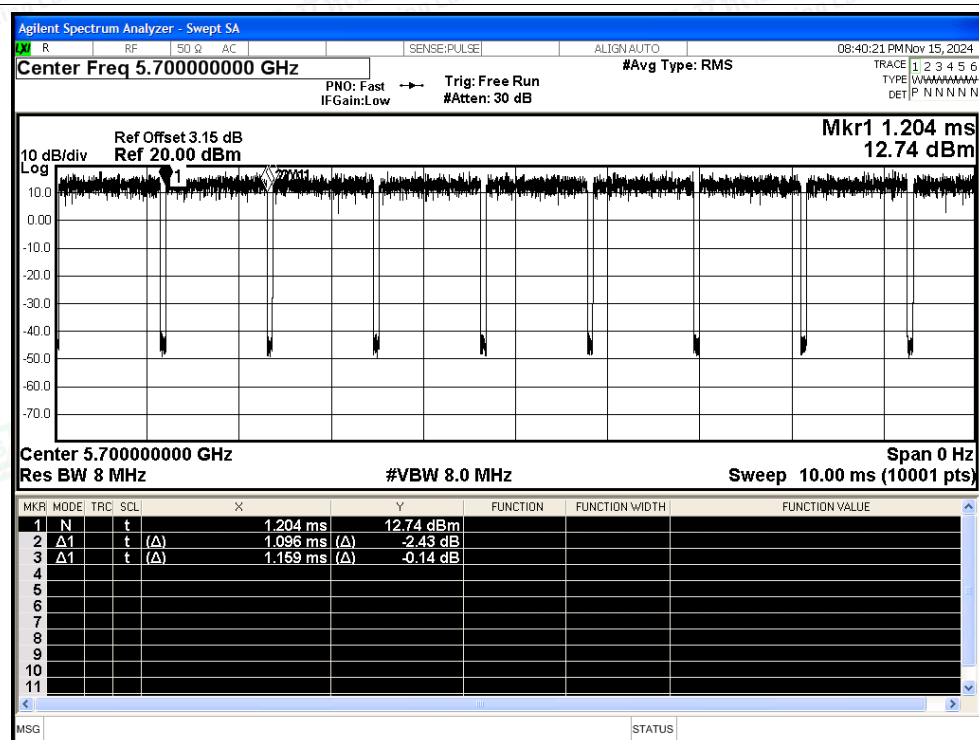


Duty Cycle NVNT n20 5500MHz Ant4

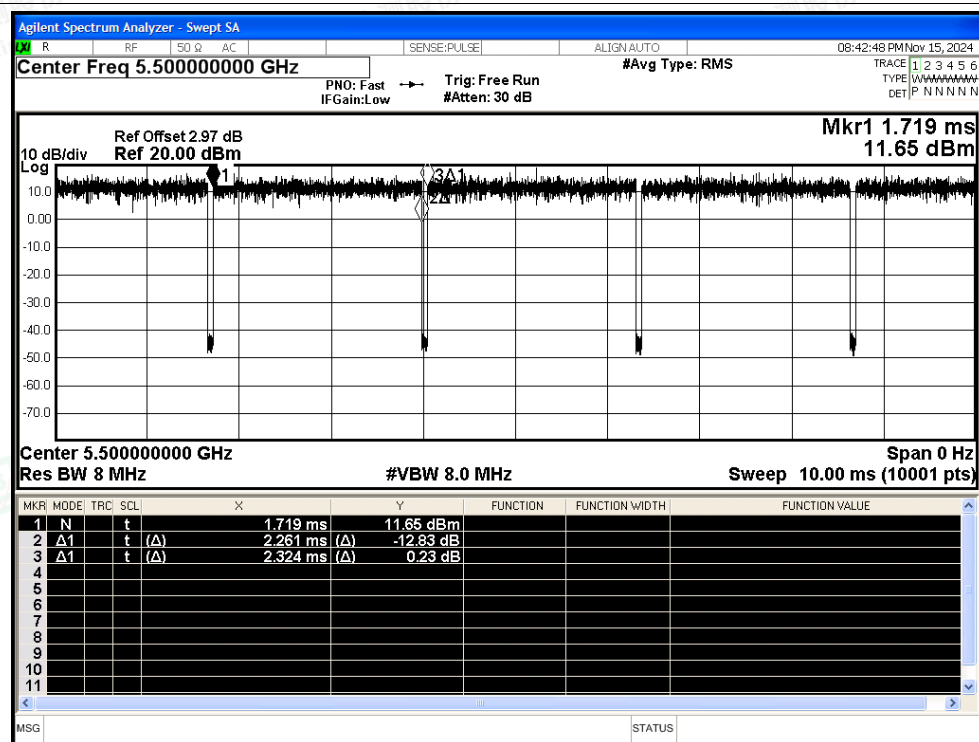




Duty Cycle NVNT n20 5580MHz Ant4

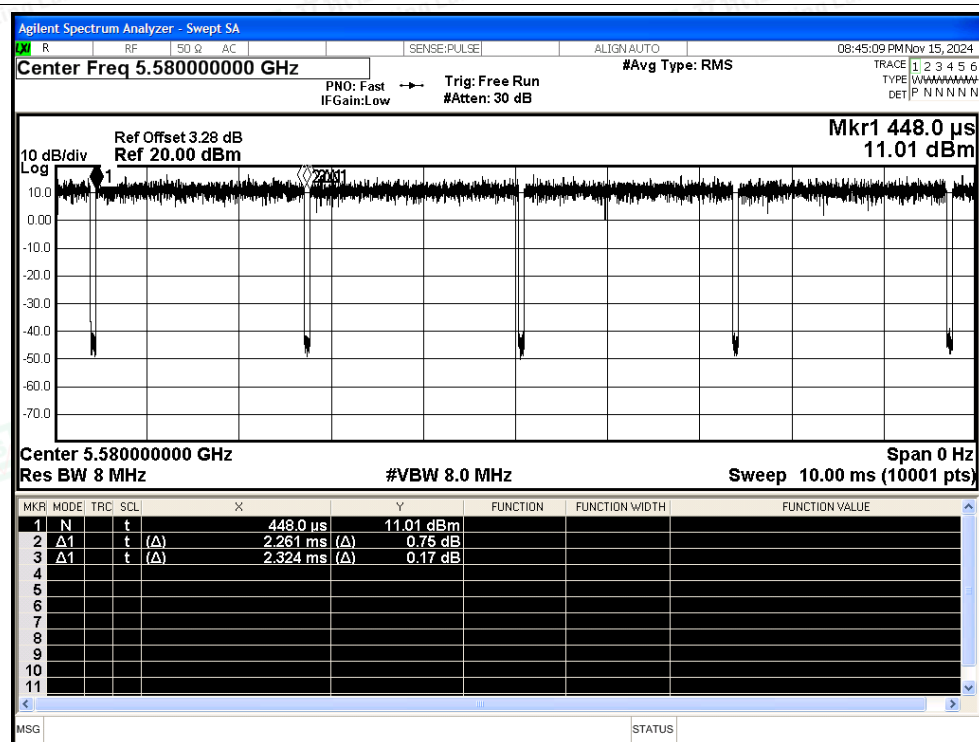

Duty Cycle NVNT n20 5700MHz Ant4

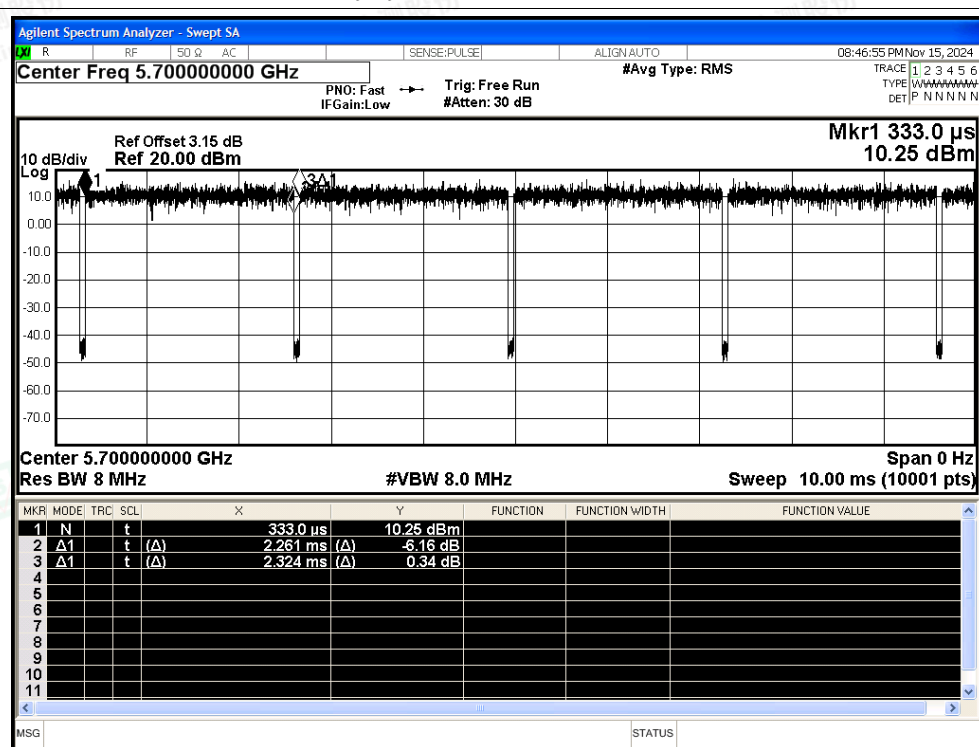

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5510MHz Ant4

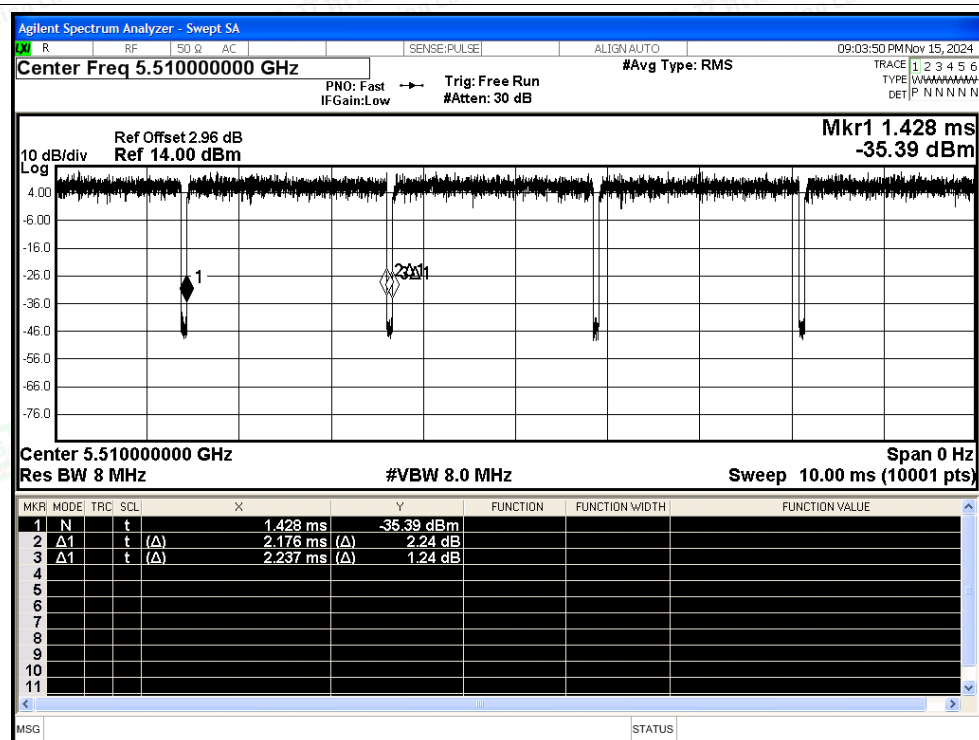


Duty Cycle NVNT n40 5550MHz Ant4

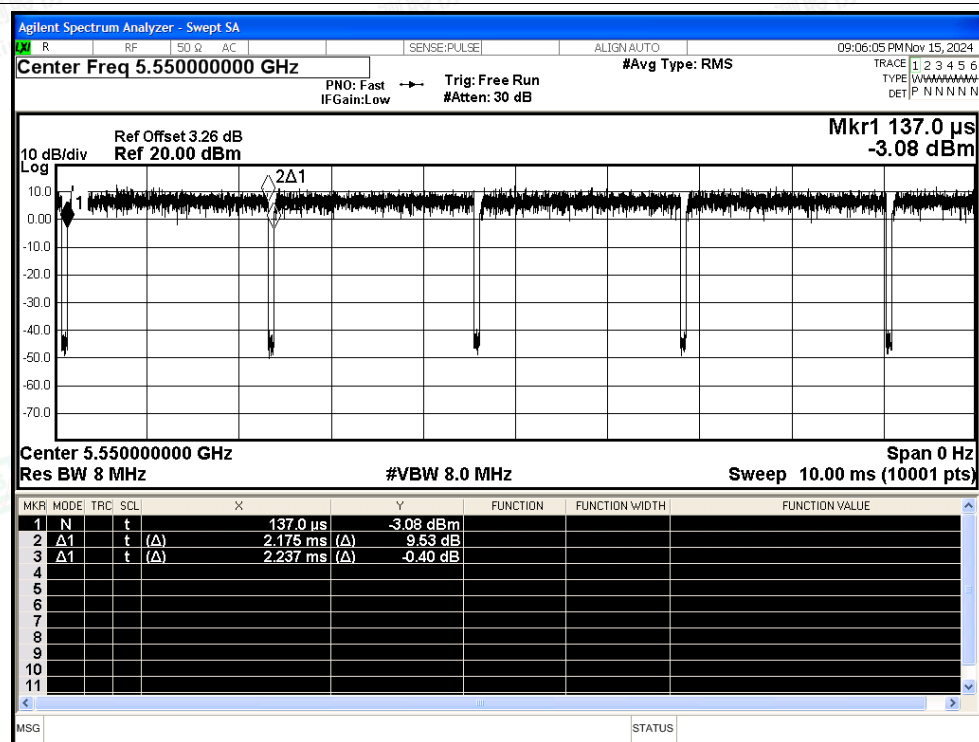




Duty Cycle NVNT n40 5670MHz Ant4

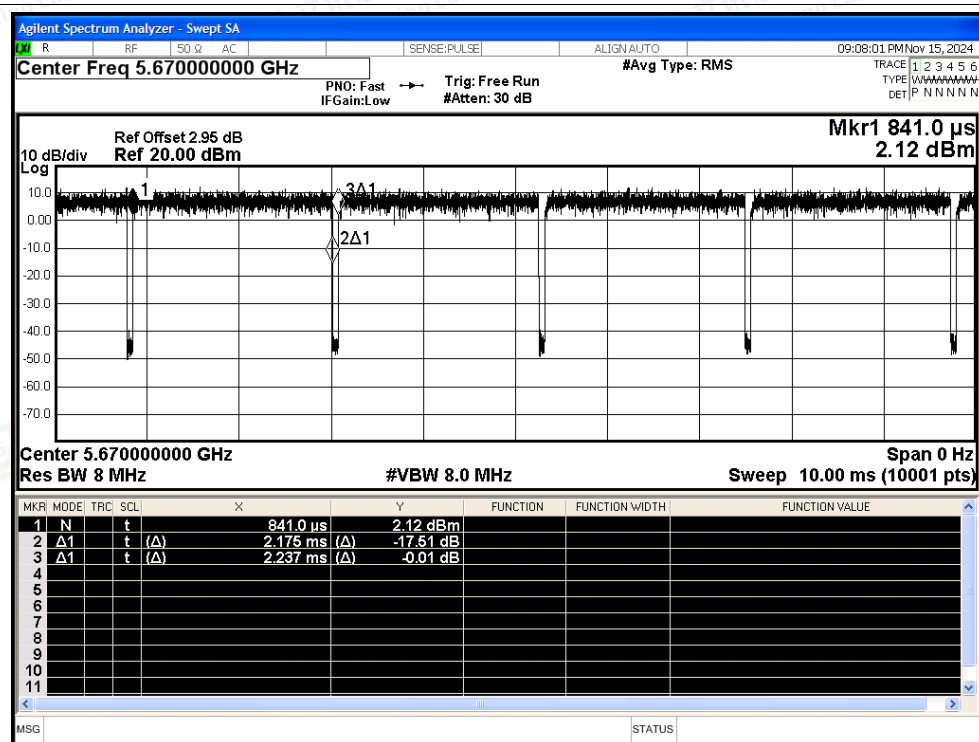


Duty Cycle NVNT ac20 5500MHz Ant4

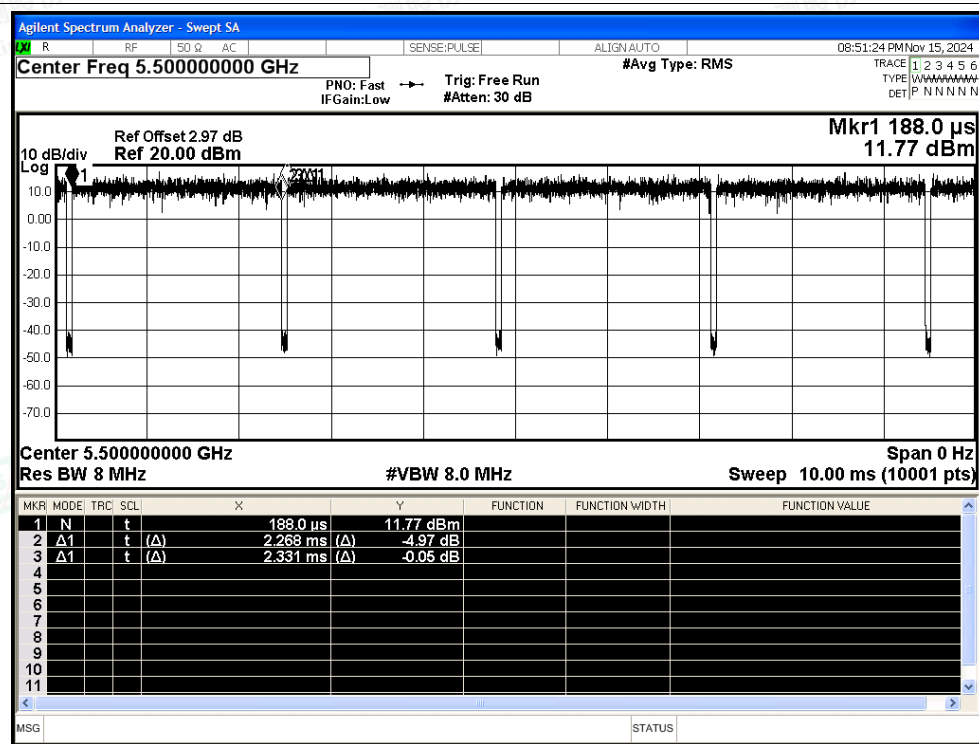




Duty Cycle NVNT ac20 5580MHz Ant4

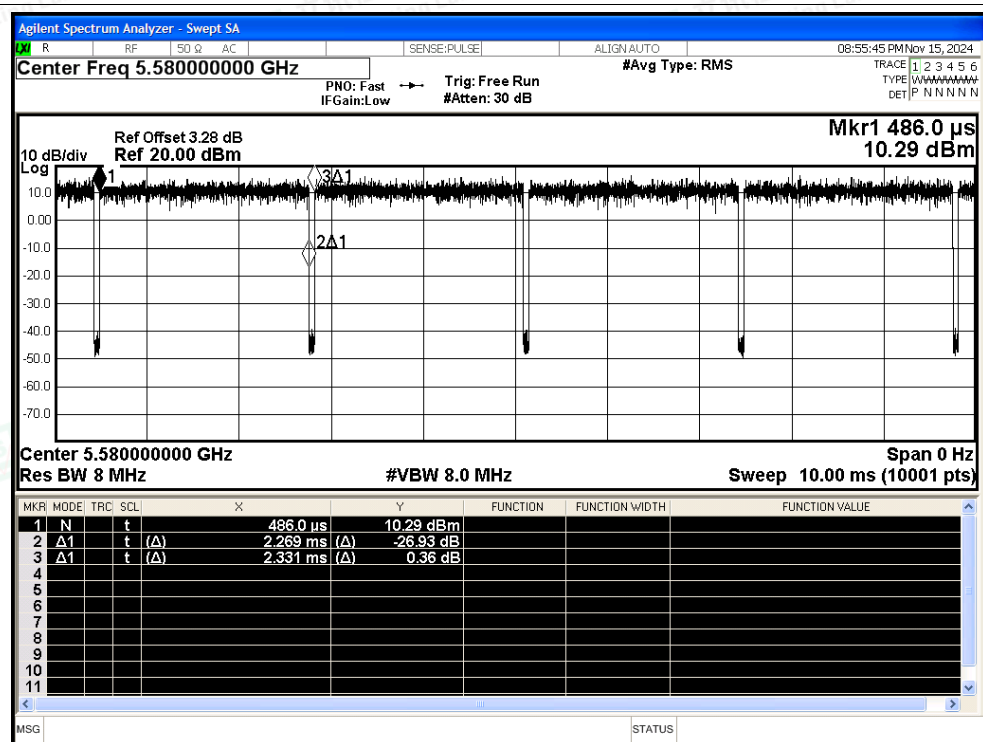


Duty Cycle NVNT ac20 5700MHz Ant4

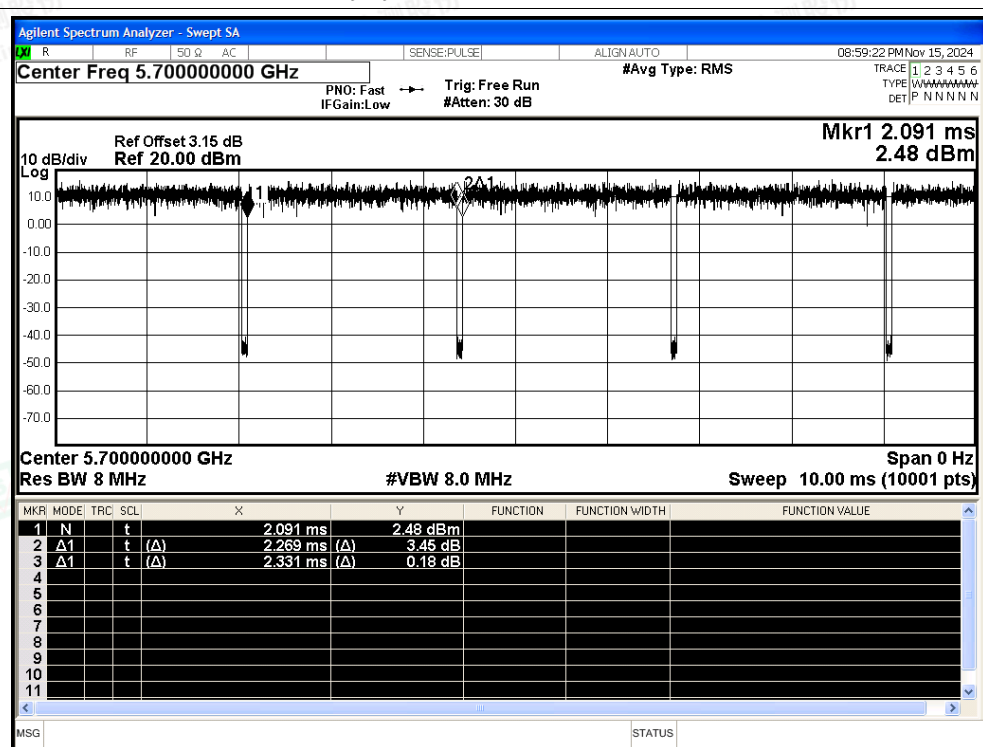




Duty Cycle NVNT ac40 5510MHz Ant4

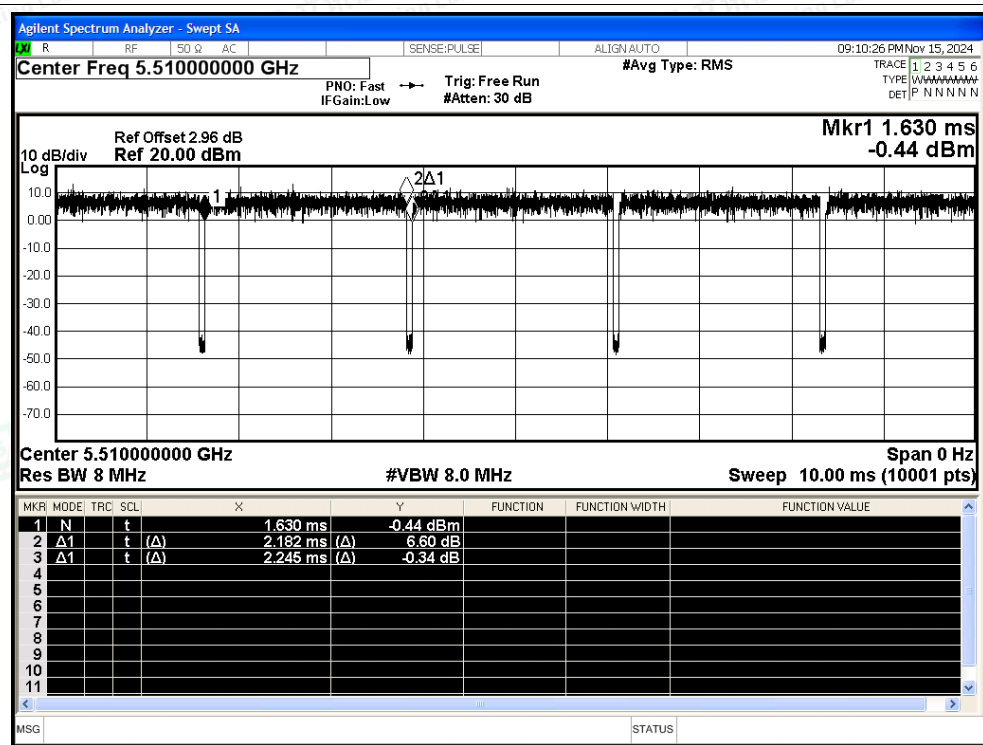


Duty Cycle NVNT ac40 5550MHz Ant4

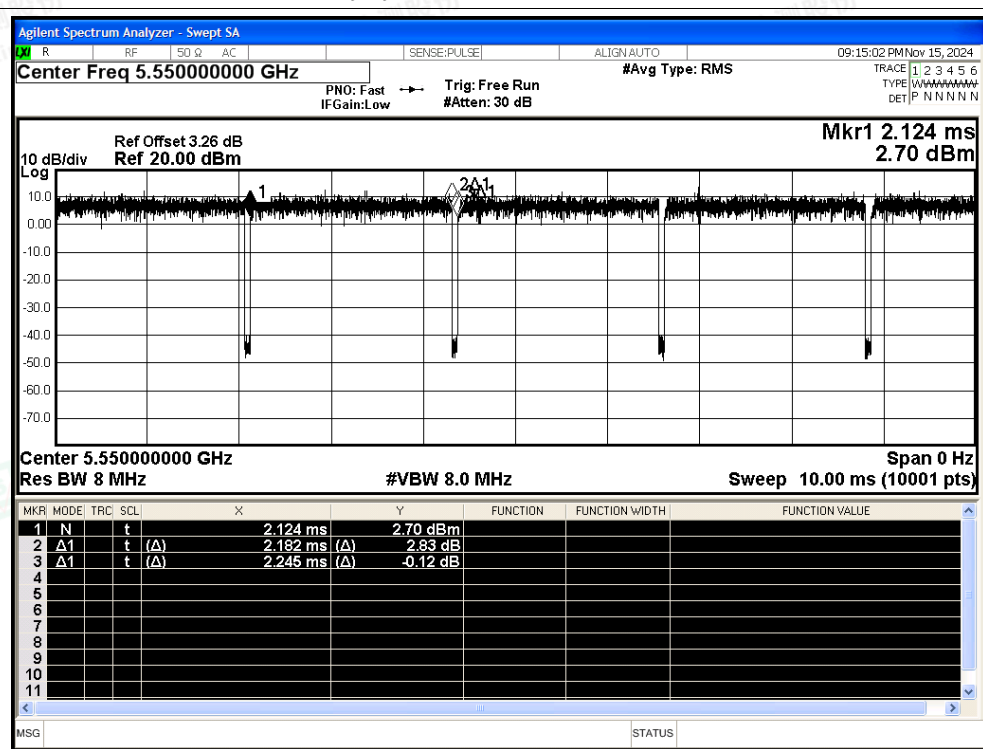




Duty Cycle NVNT ac40 5670MHz Ant4

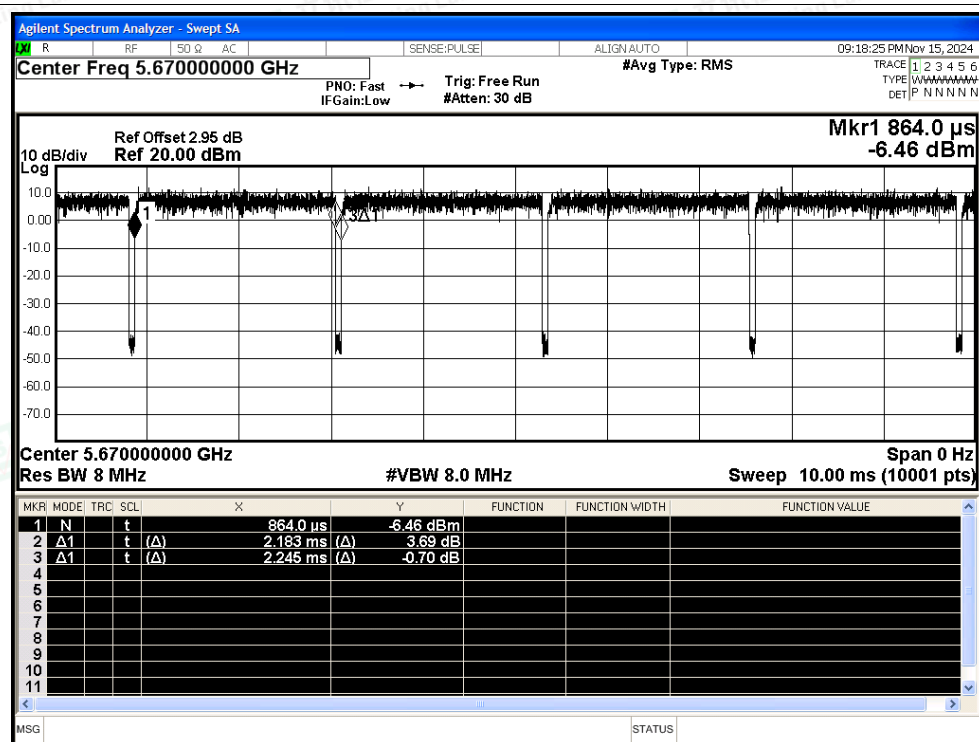

Duty Cycle NVNT ac80 5530MHz Ant4

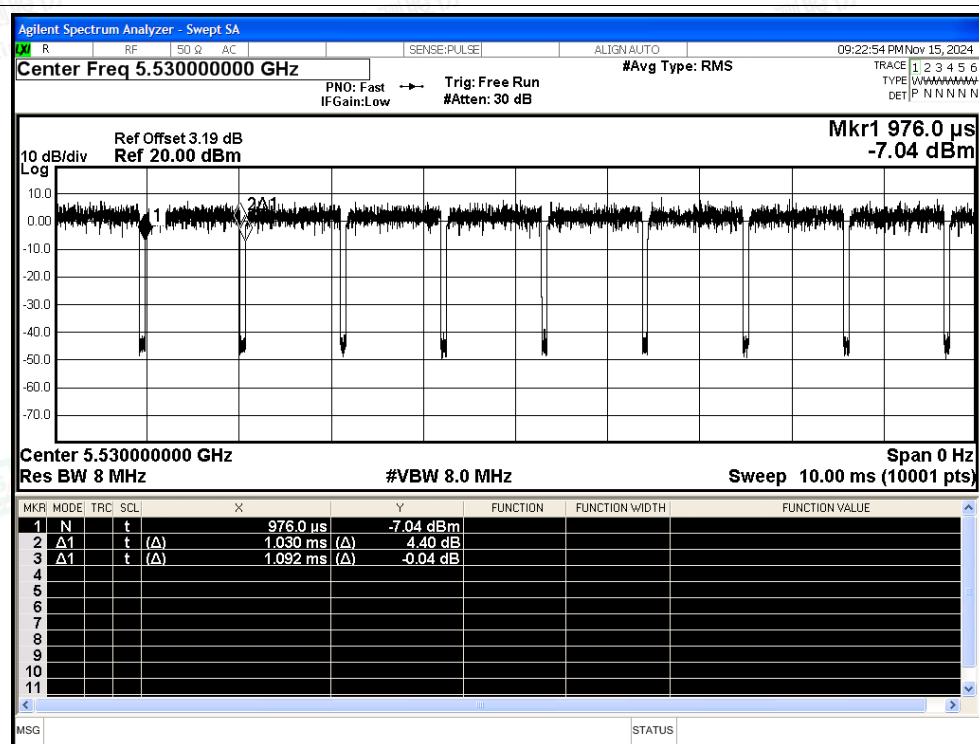

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac80 5610MHz Ant4

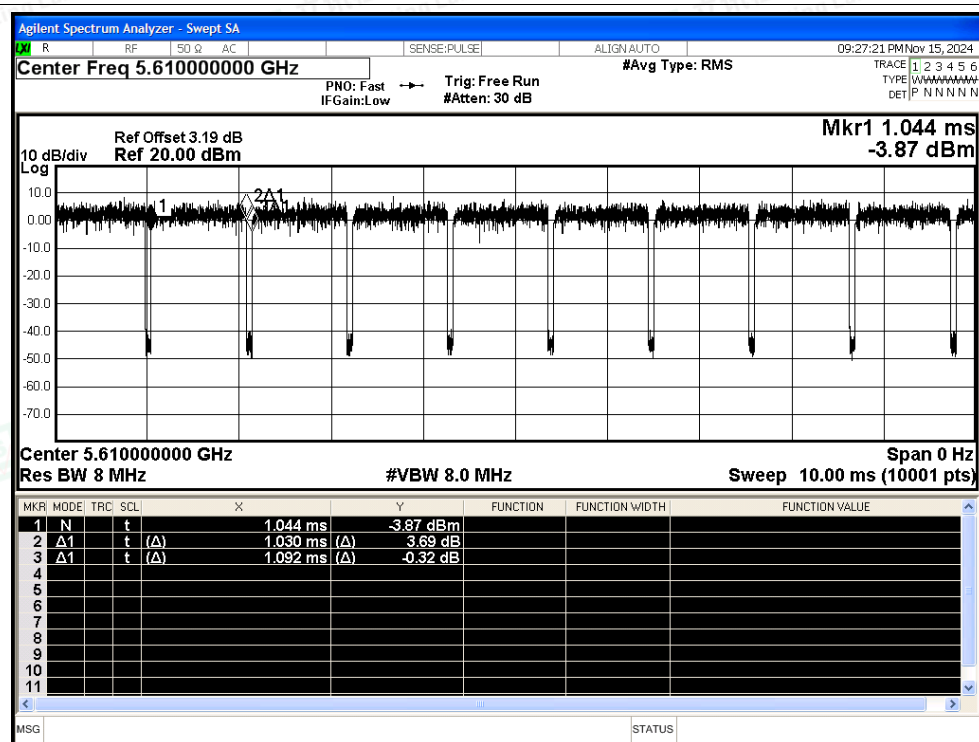


Duty Cycle NVNT ax20 5500MHz Ant4

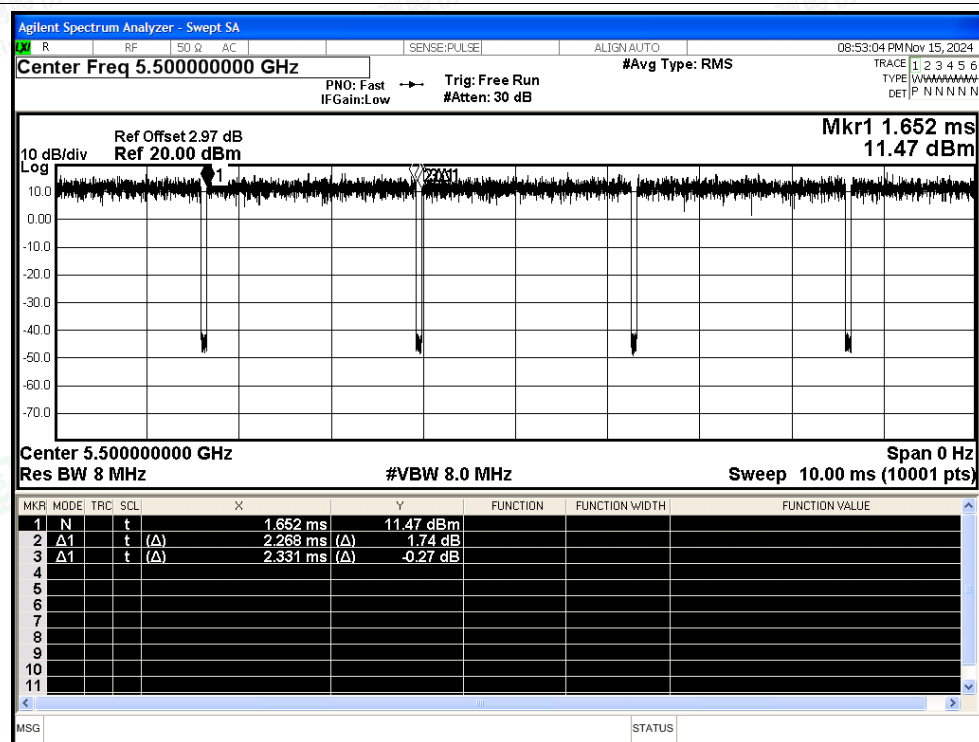




Duty Cycle NVNT ax20 5580MHz Ant4

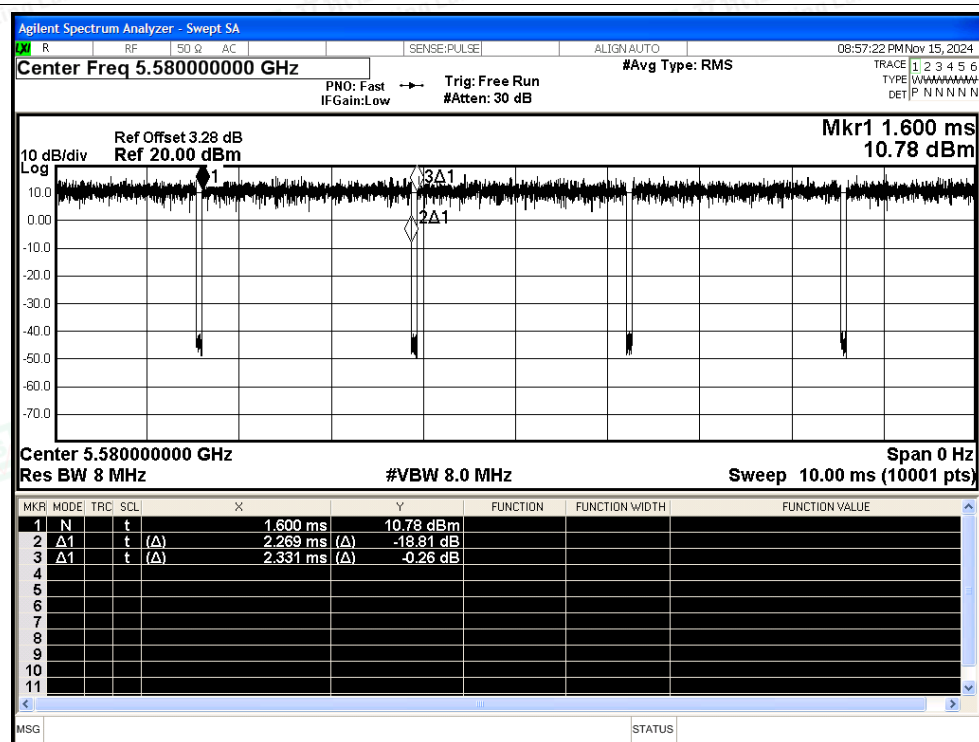

Duty Cycle NVNT ax20 5700MHz Ant4

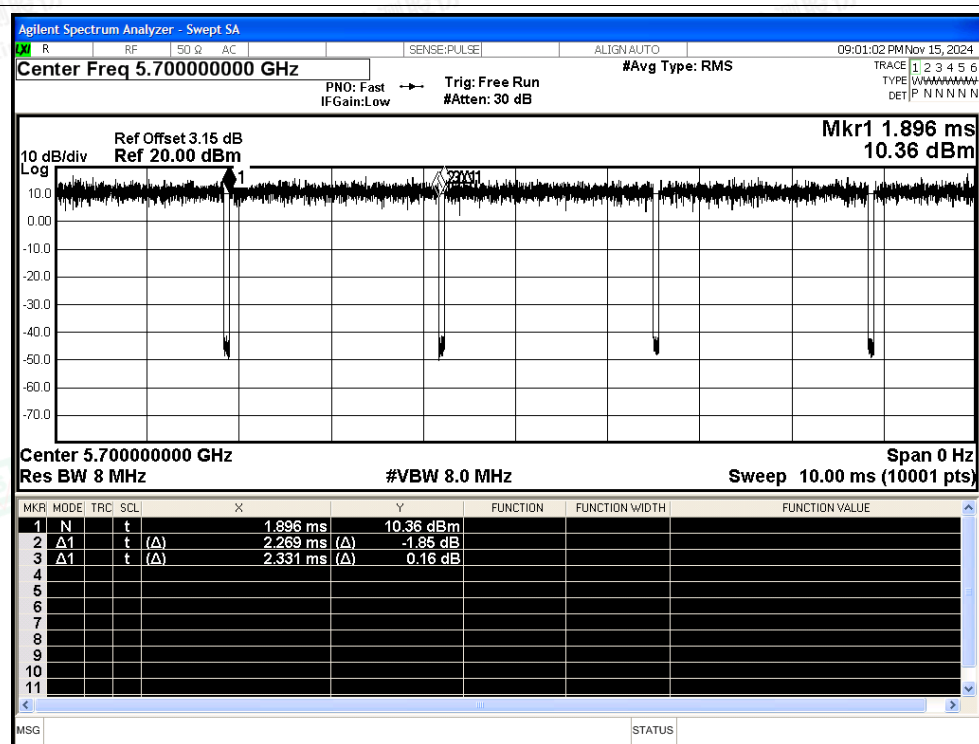

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5510MHz Ant4

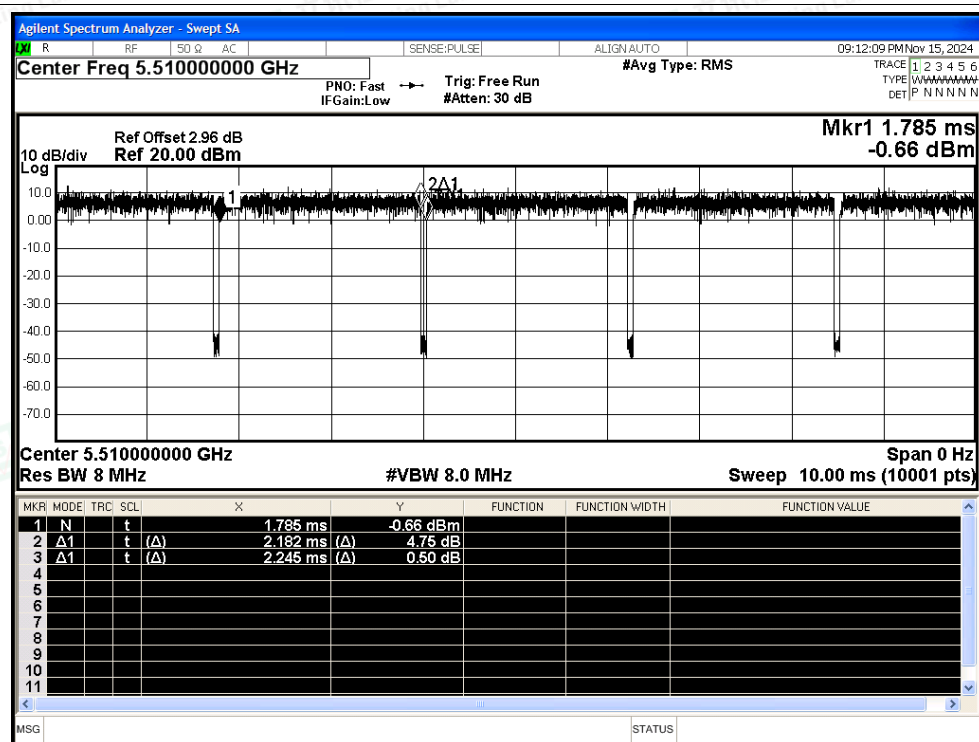


Duty Cycle NVNT ax40 5550MHz Ant4

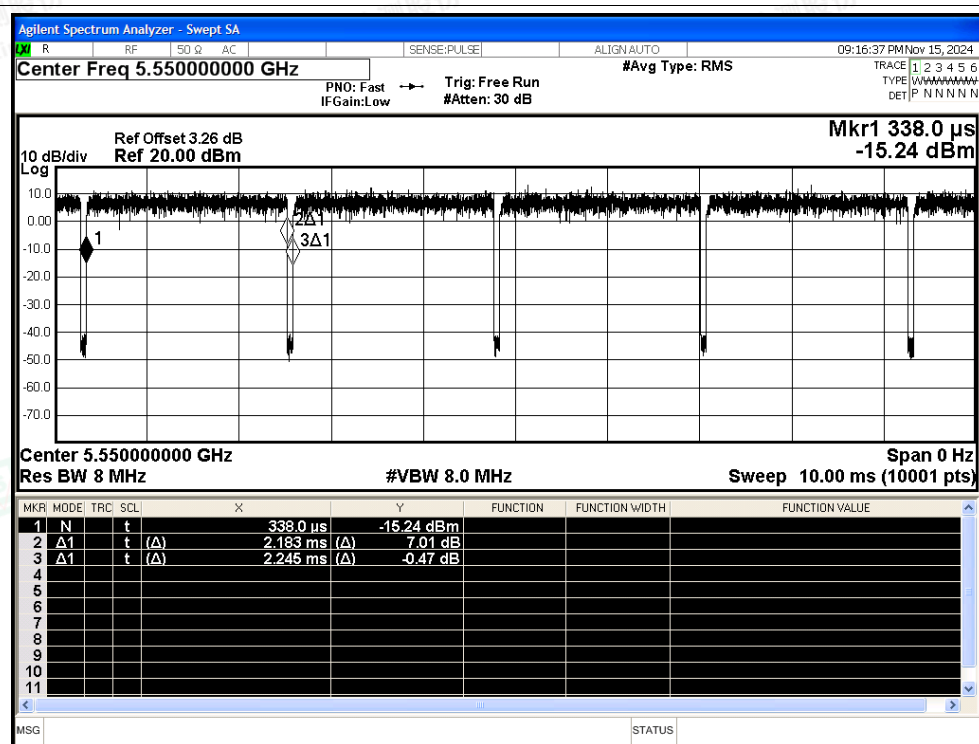





Duty Cycle NVNT ax40 5670MHz Ant4

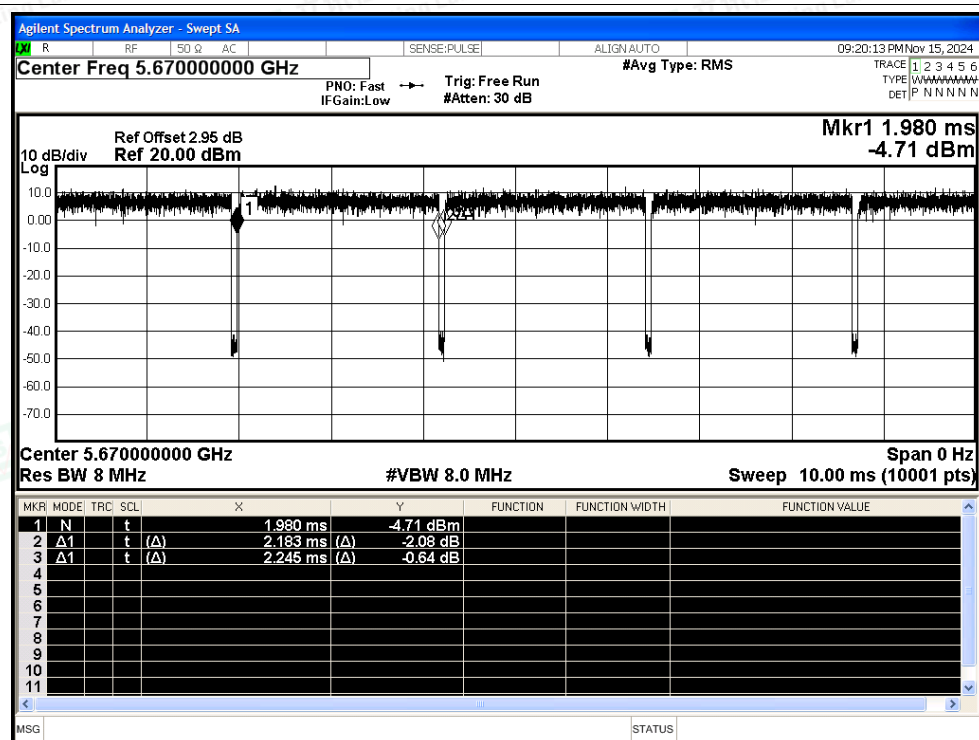

Duty Cycle NVNT ax80 5530MHz Ant4

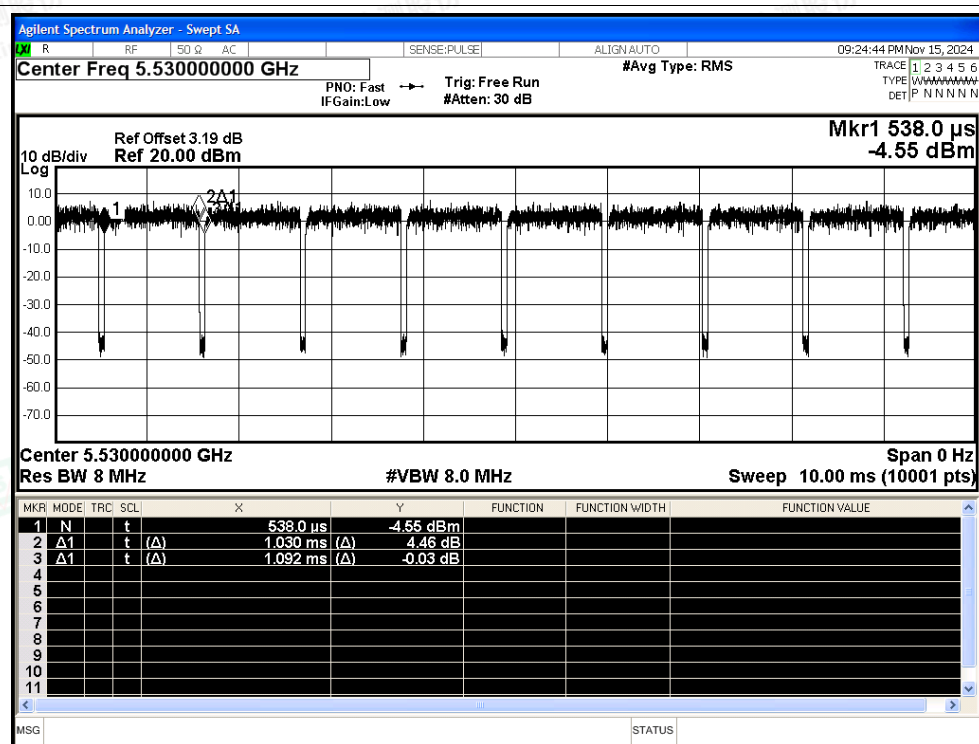


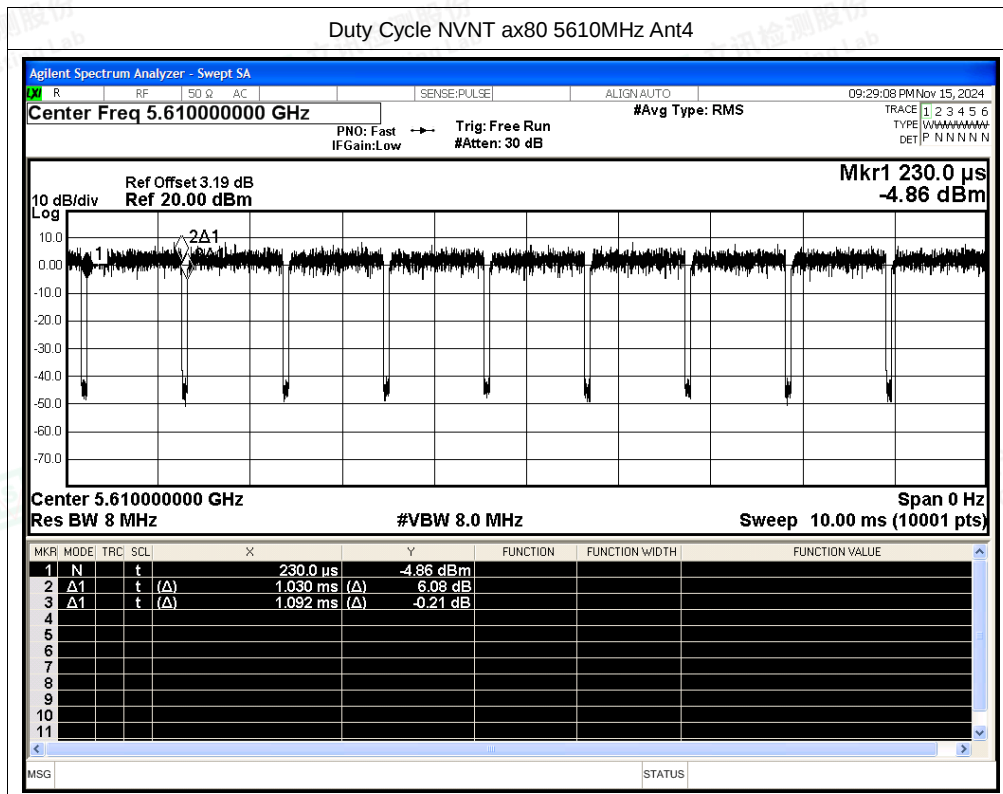




Test Graphs

Duty Cycle NVNT ac160 5570MHz Ant4

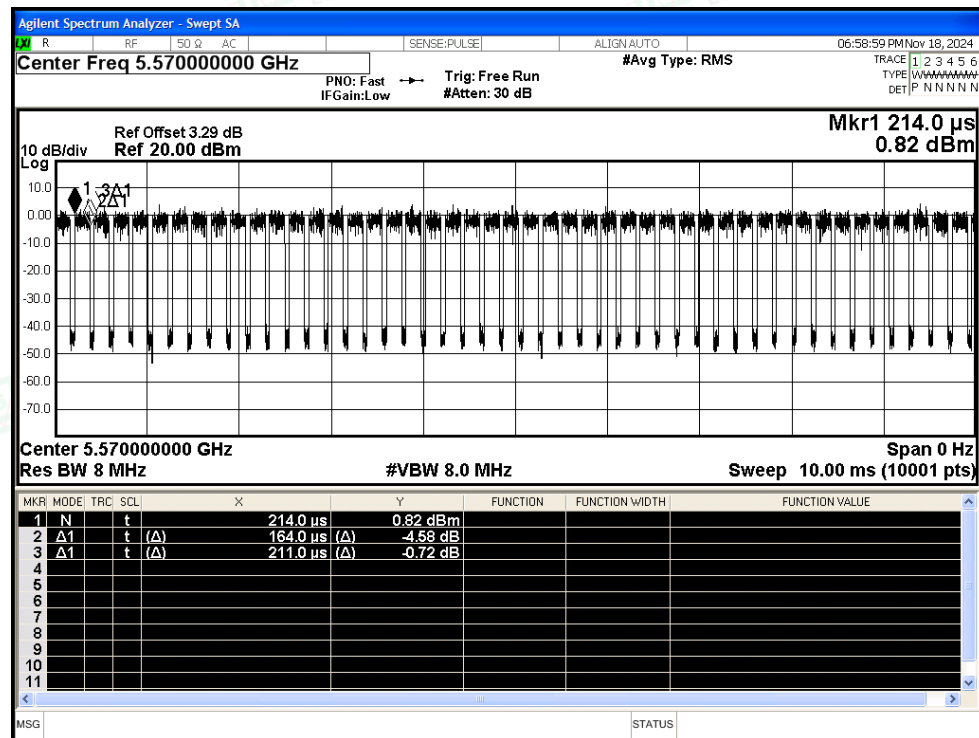

Duty Cycle NVNT ax160 5570MHz Ant4

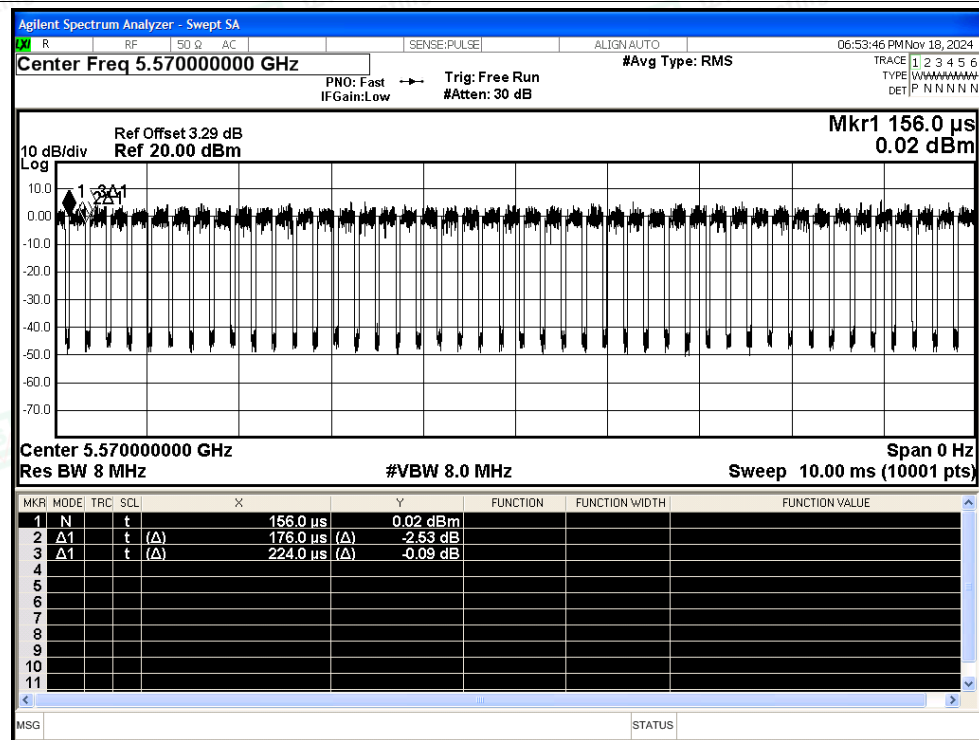

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity