




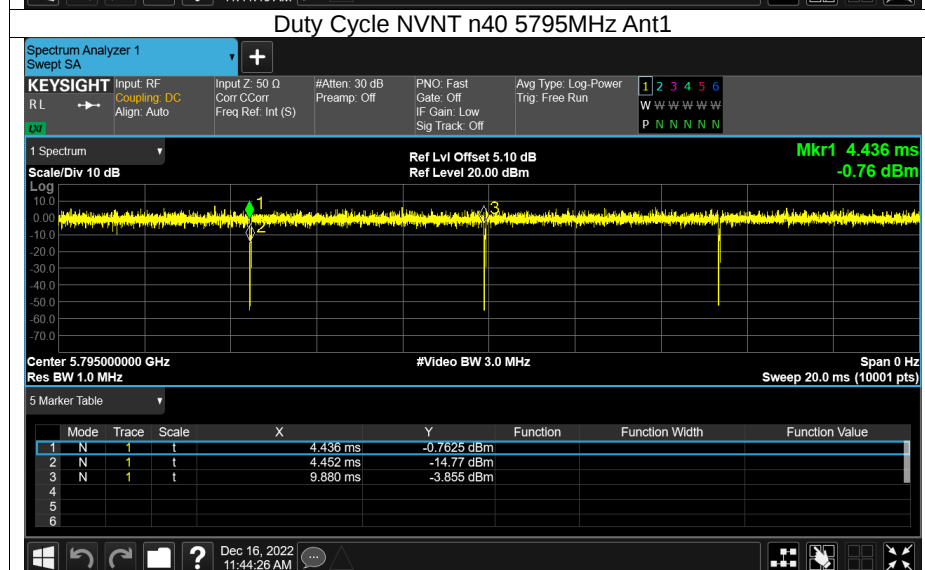
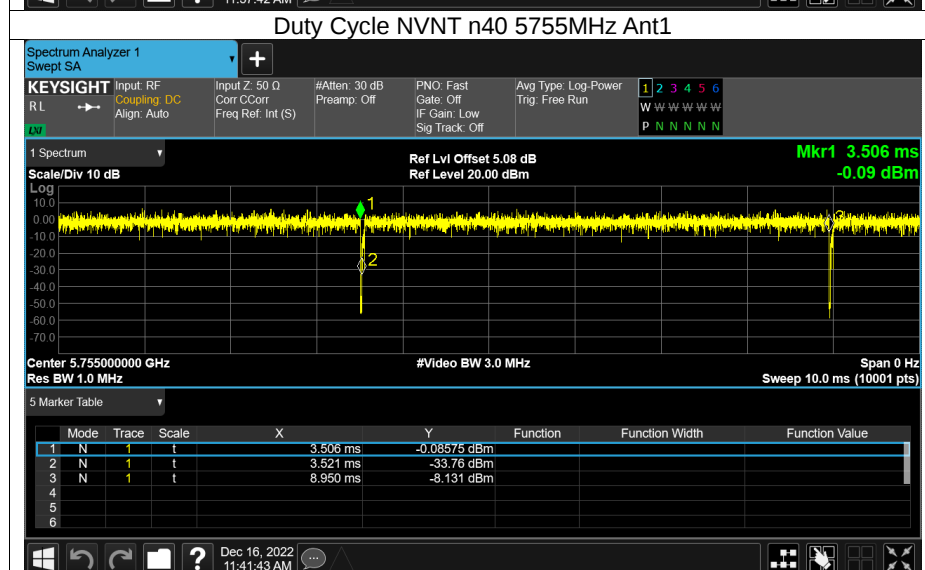
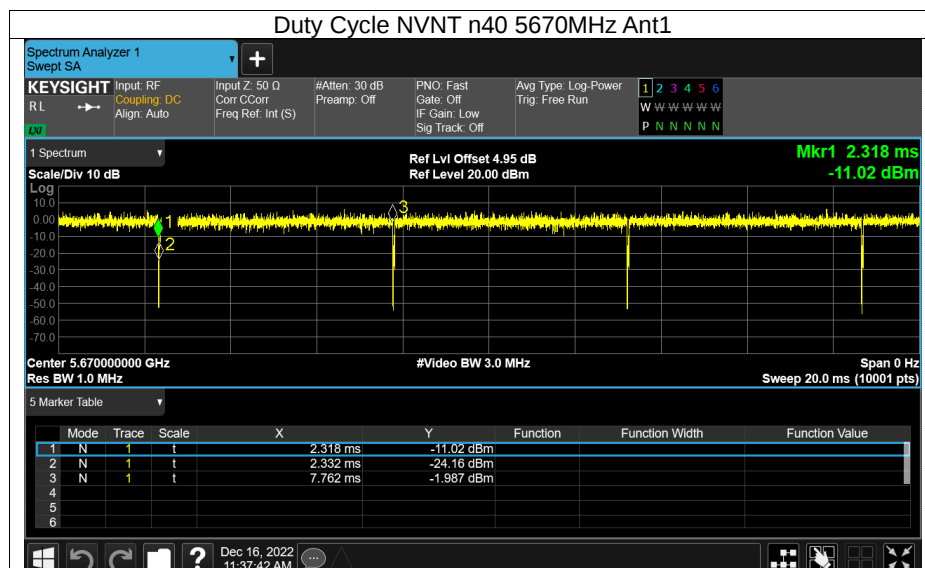
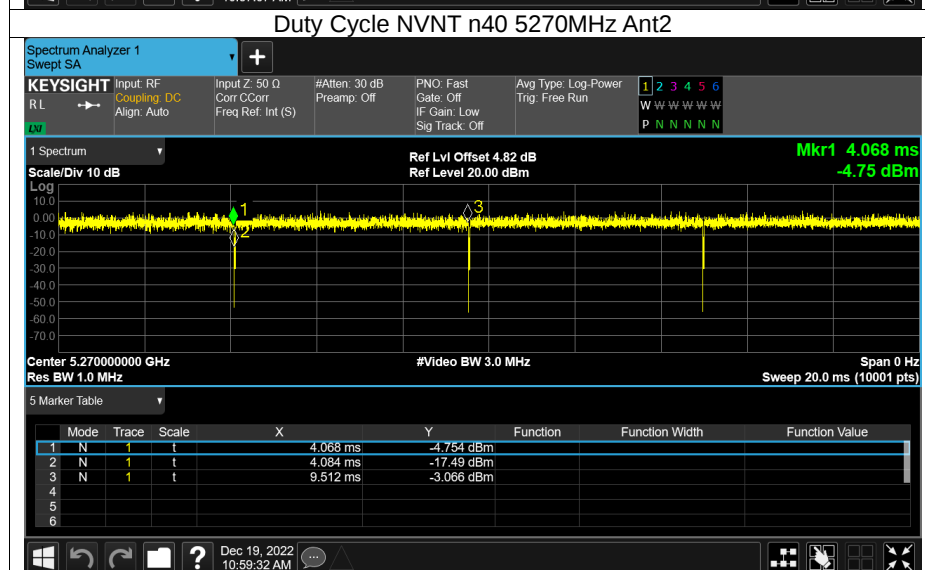
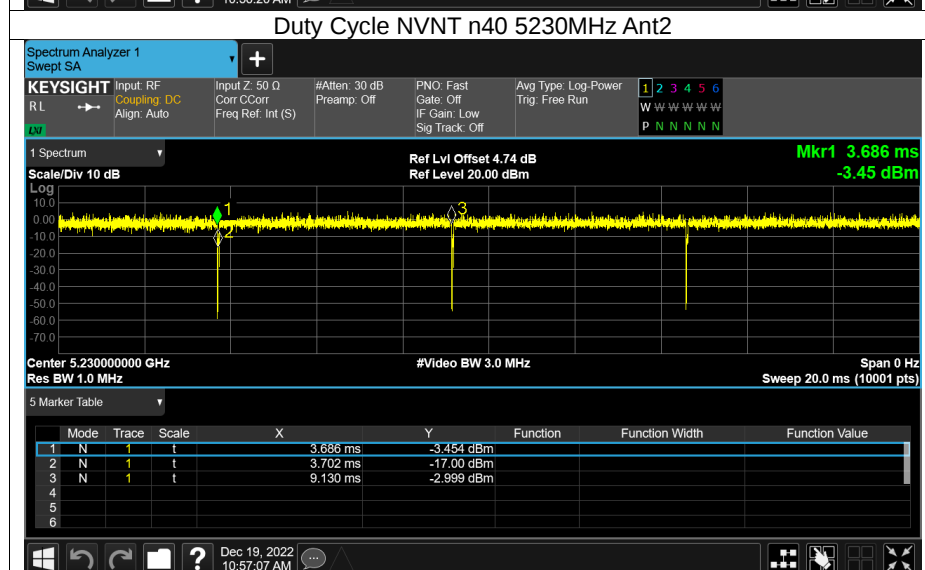
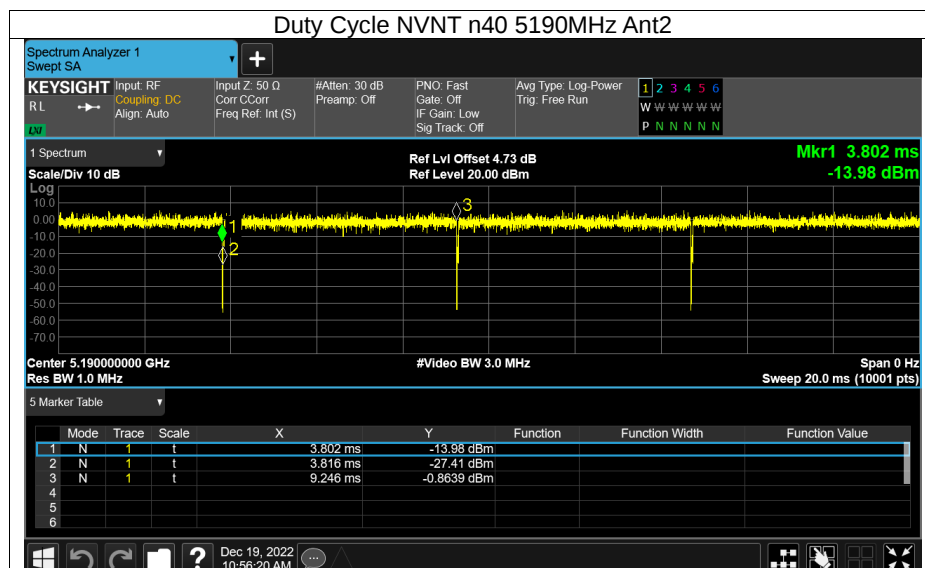




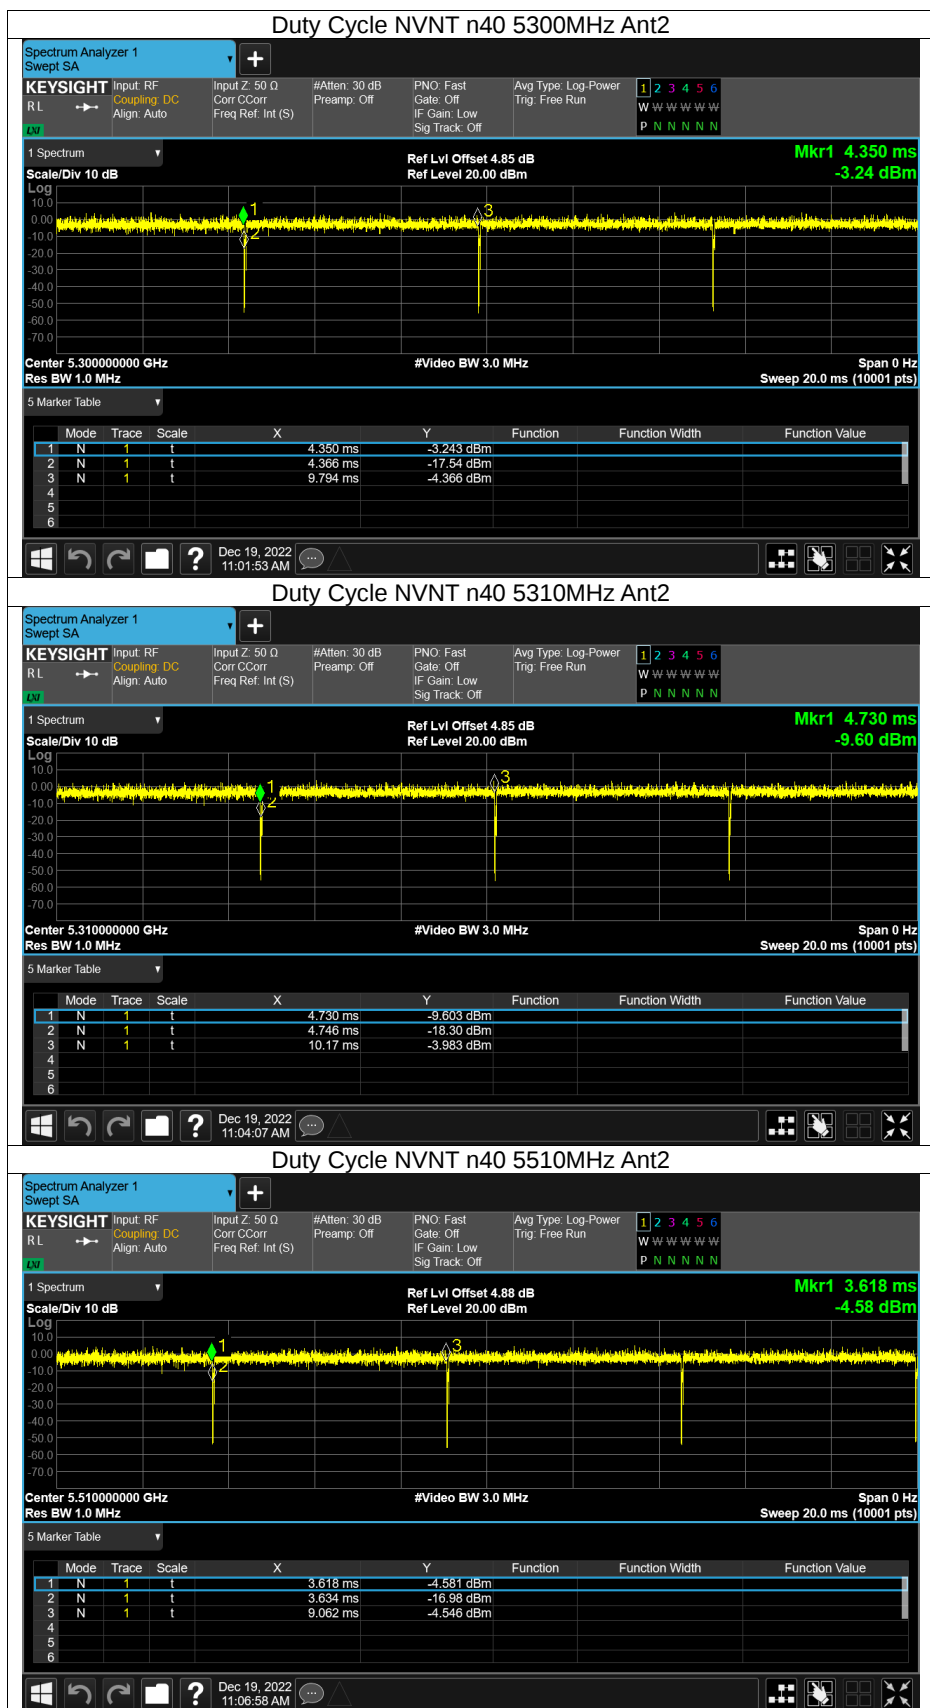


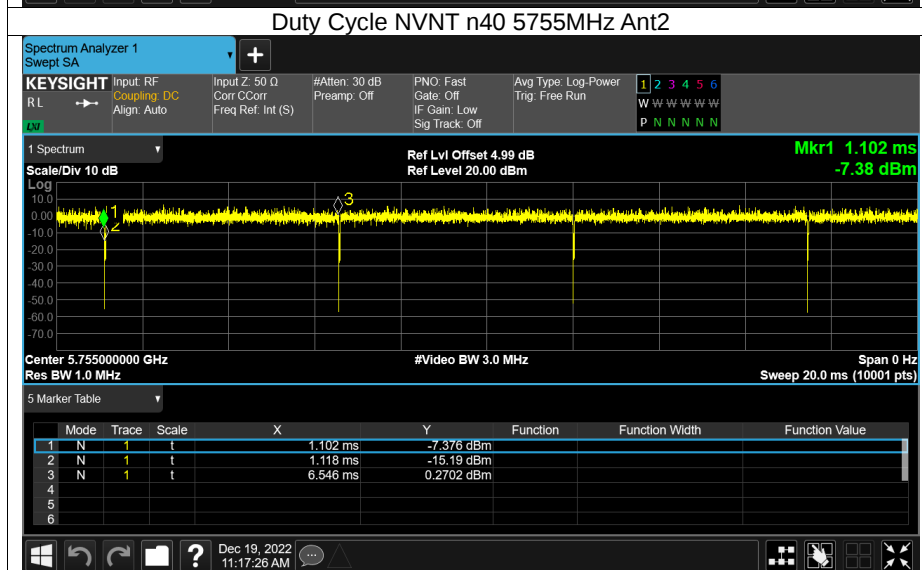




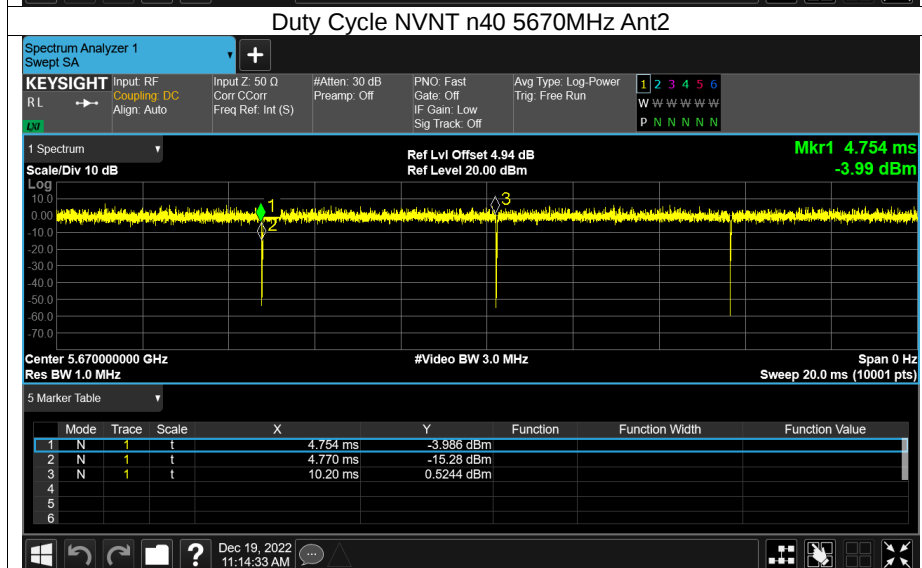


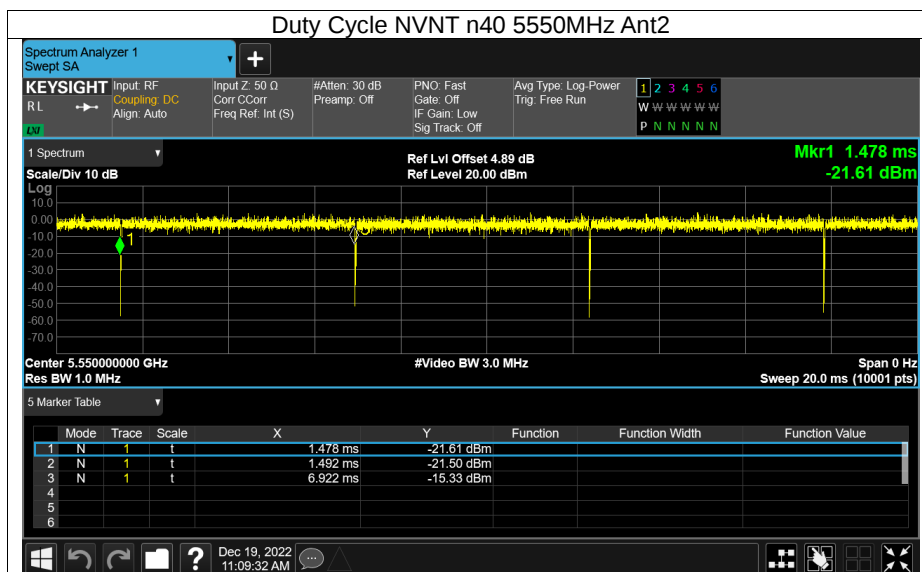




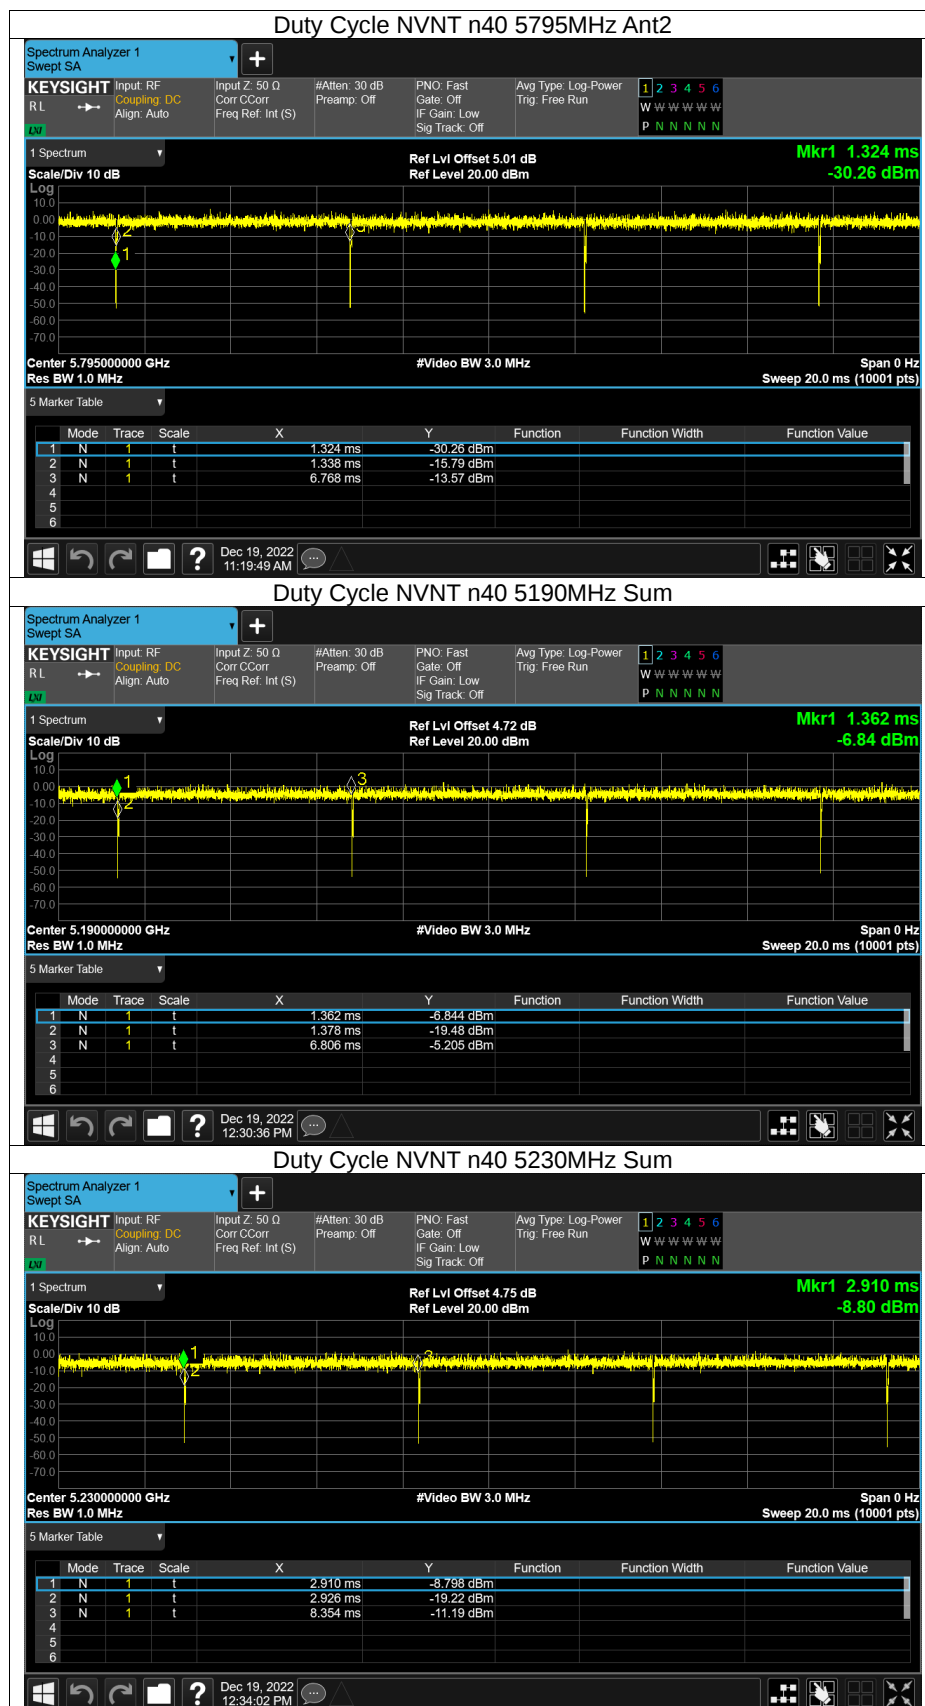


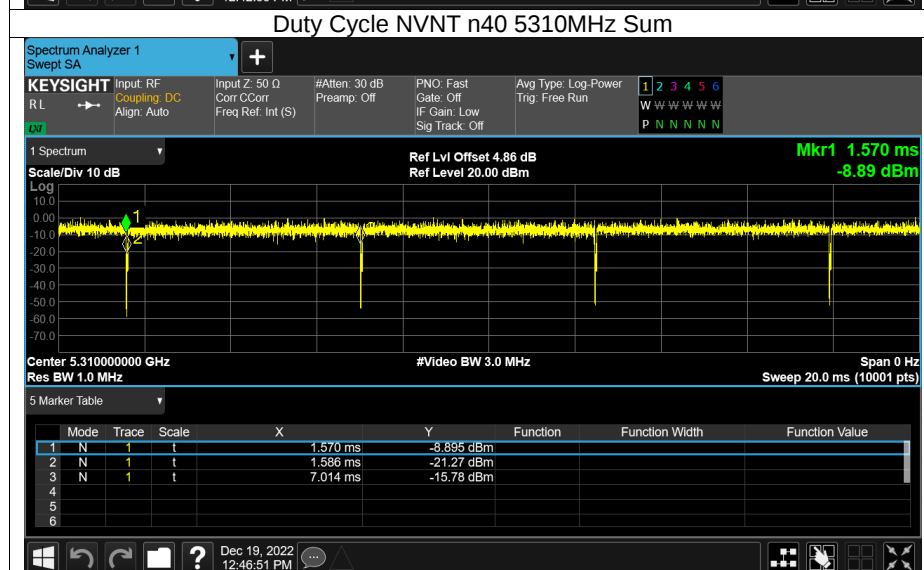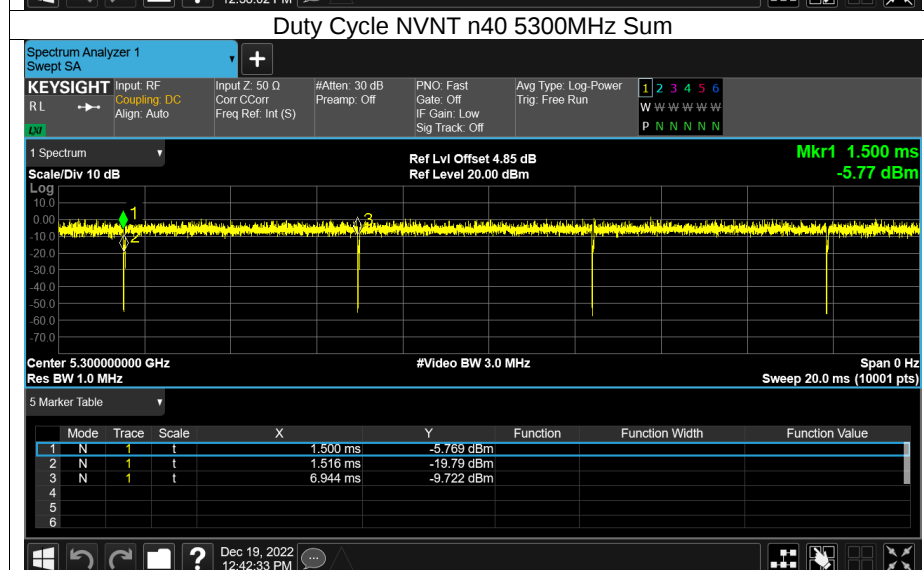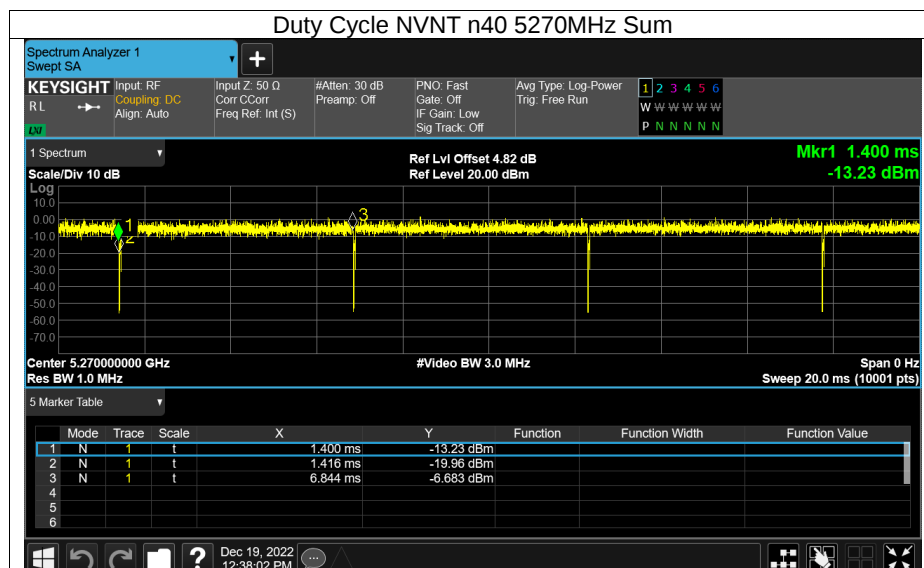




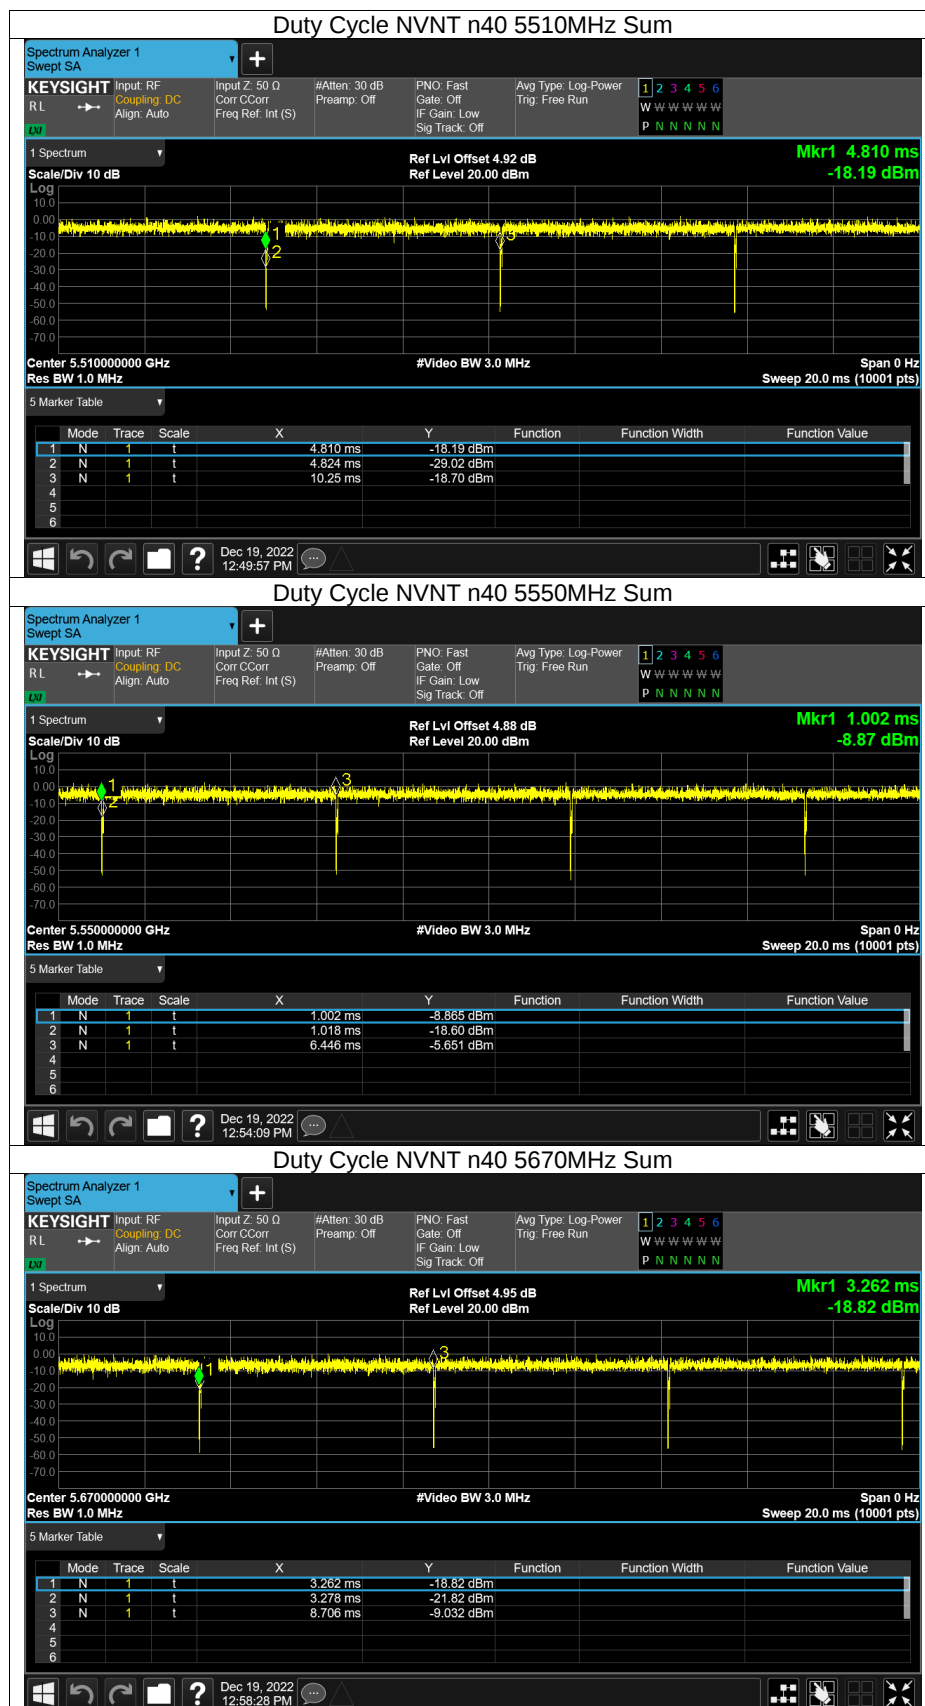


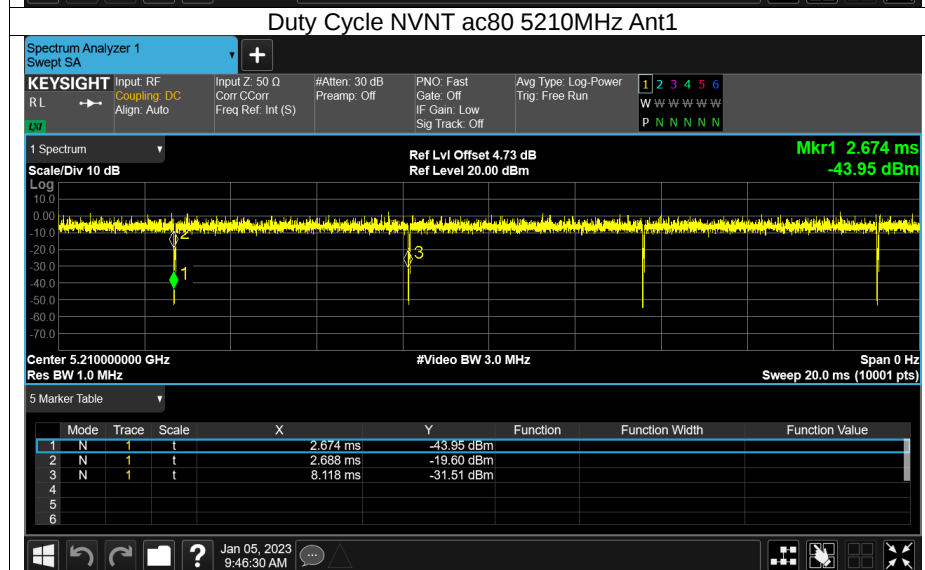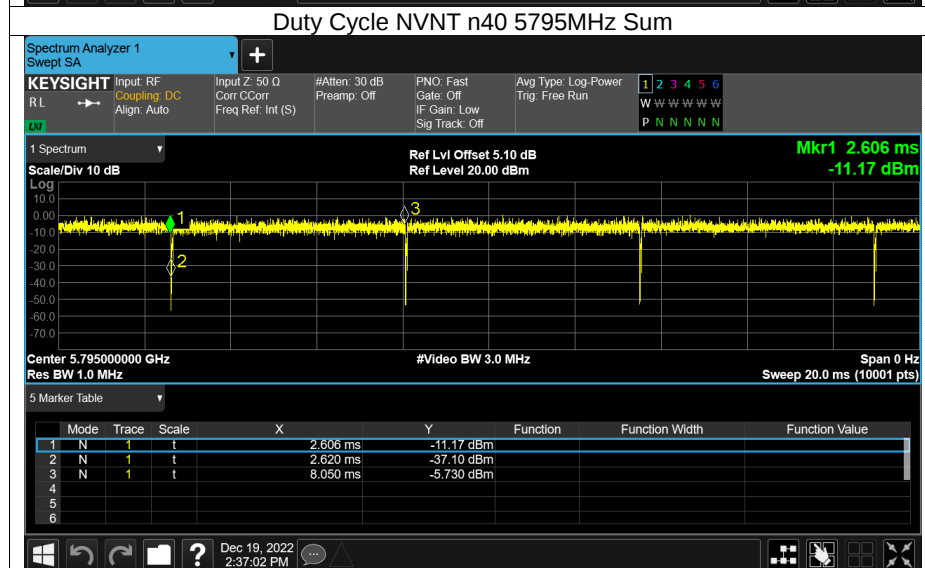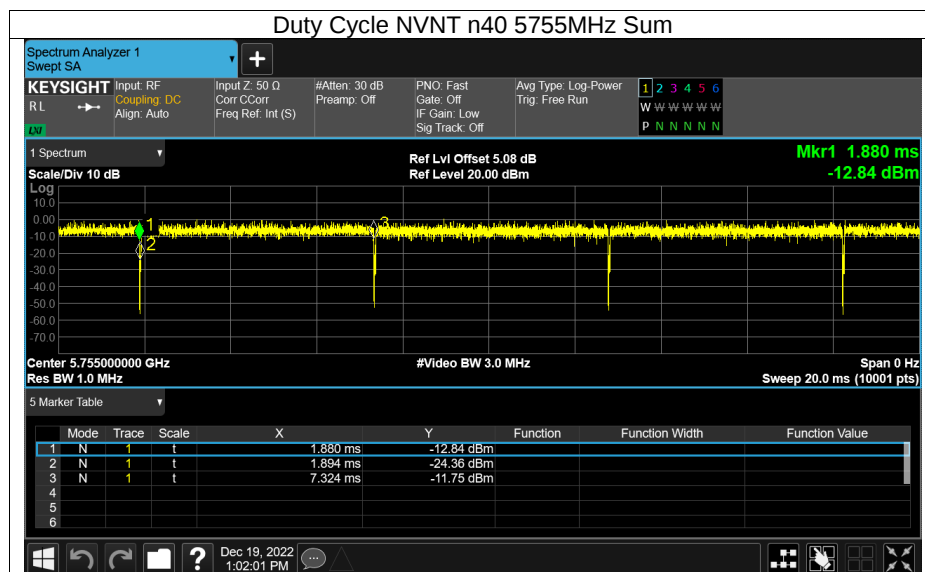




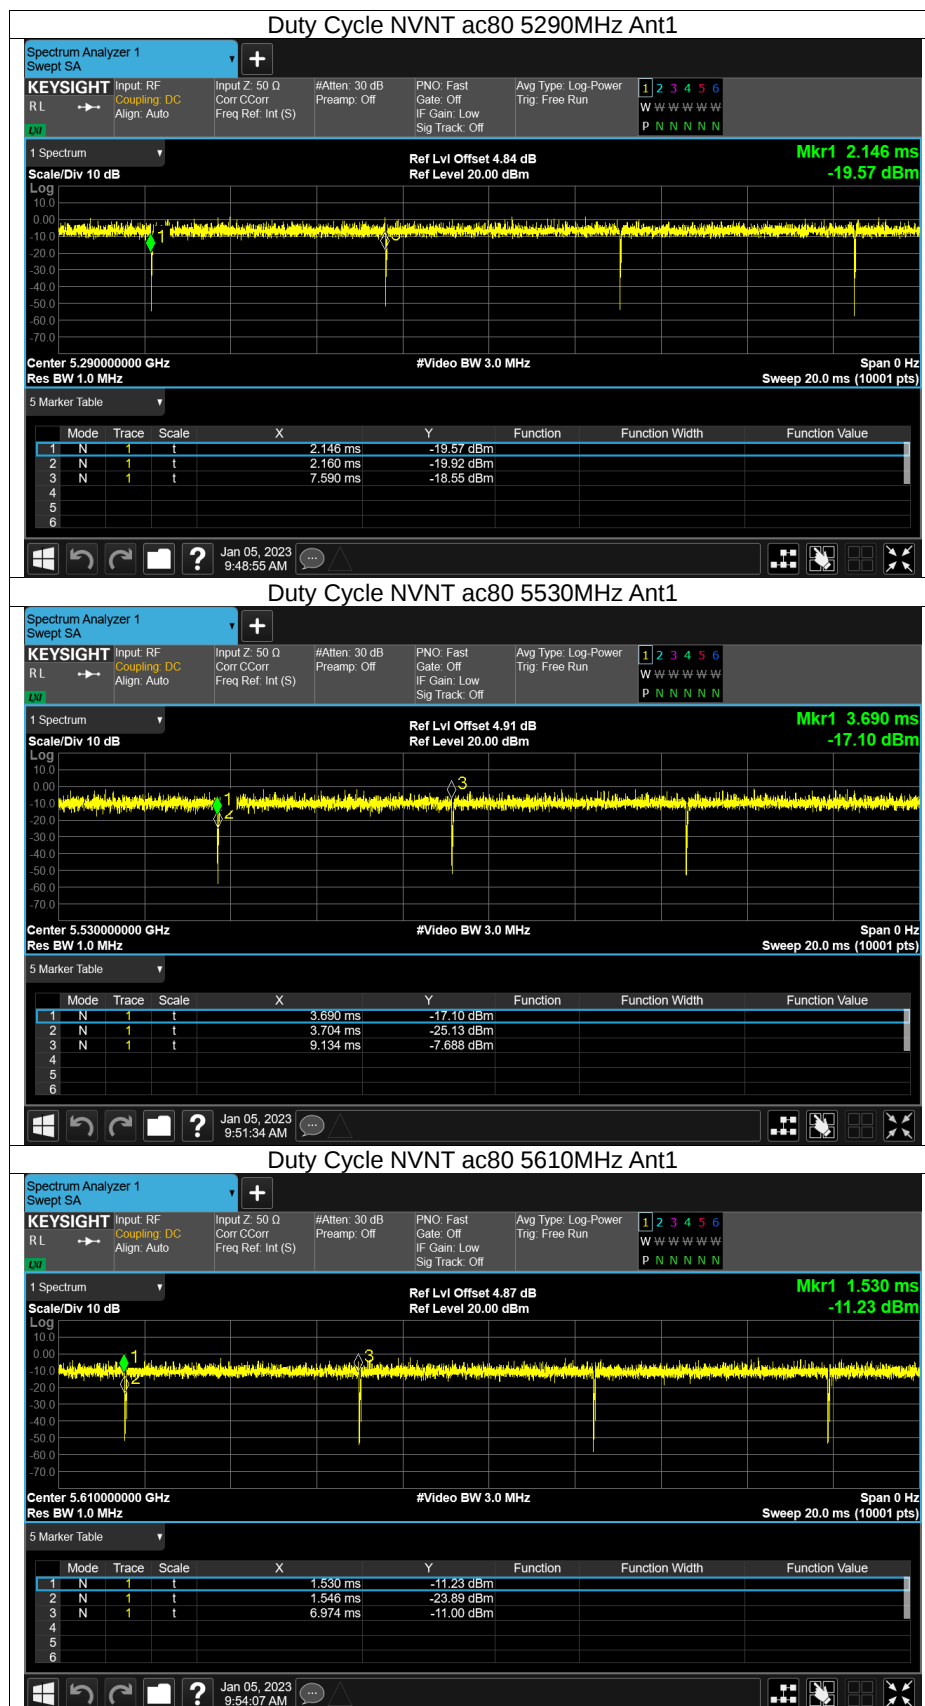


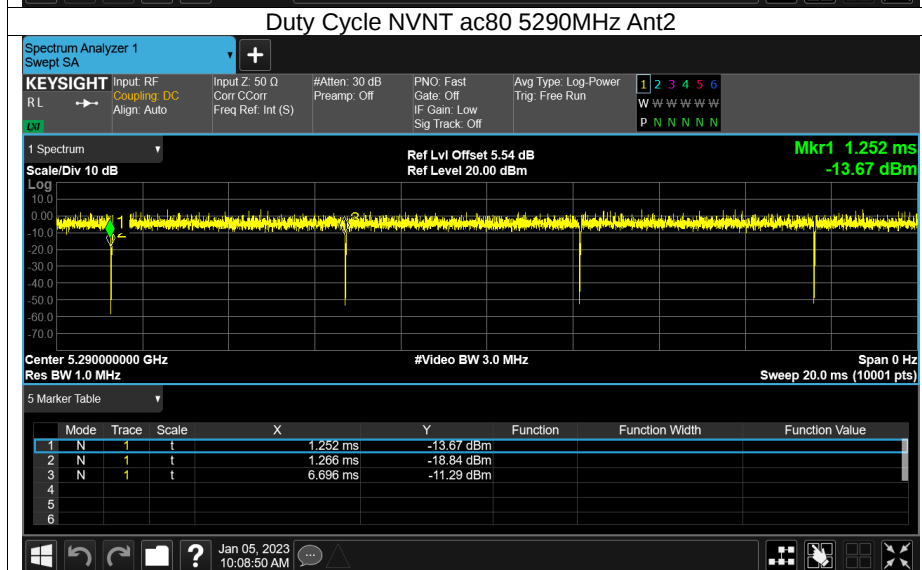
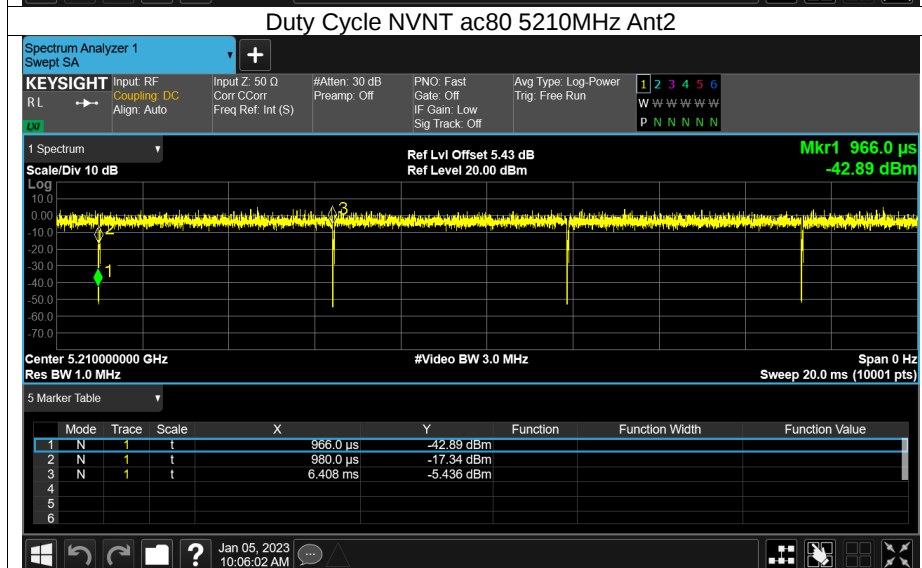
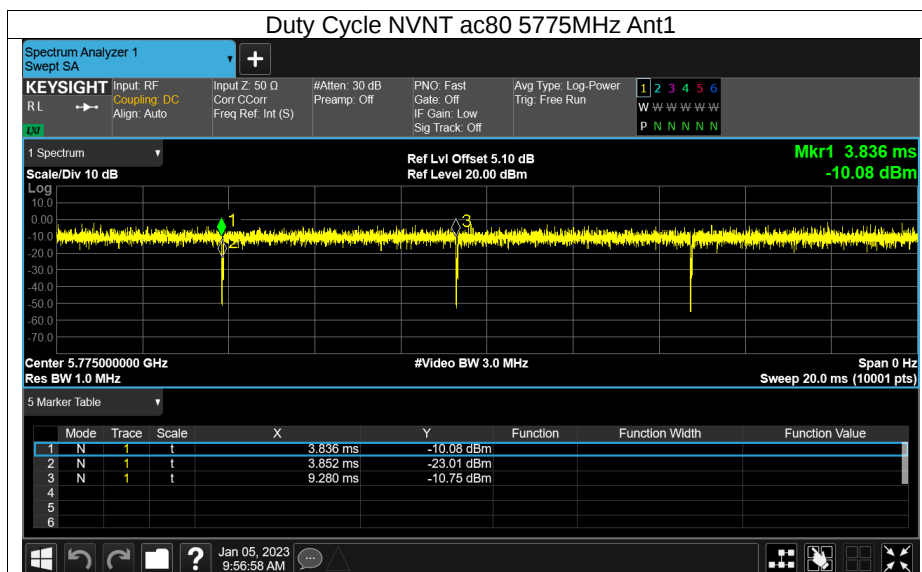


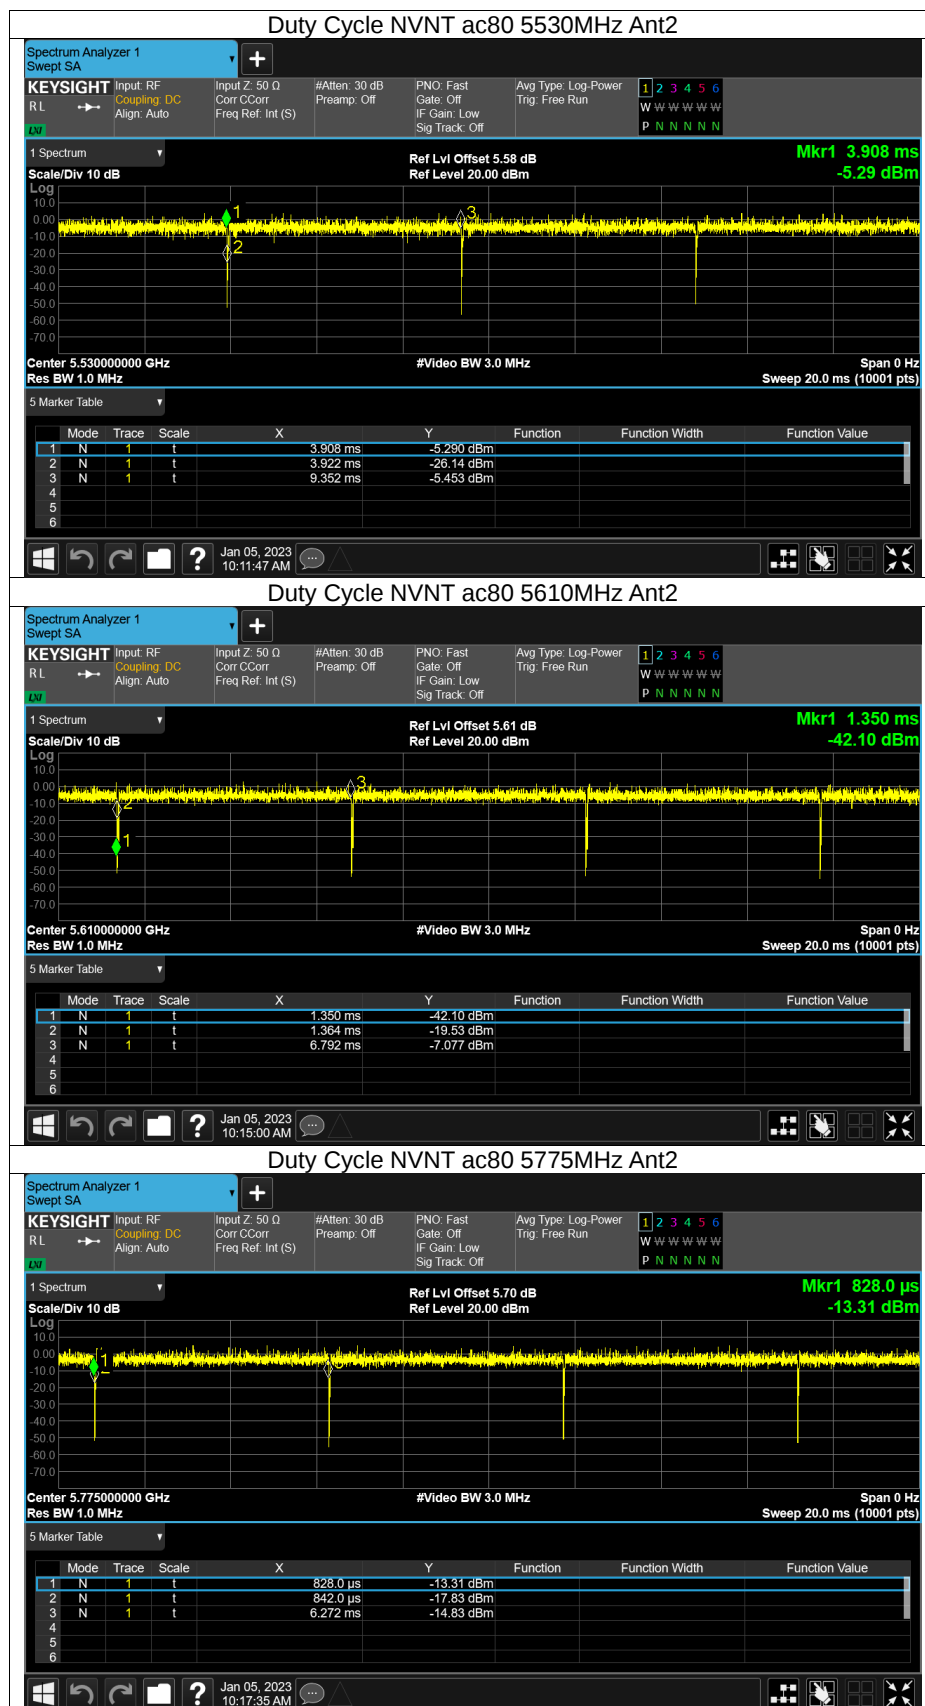


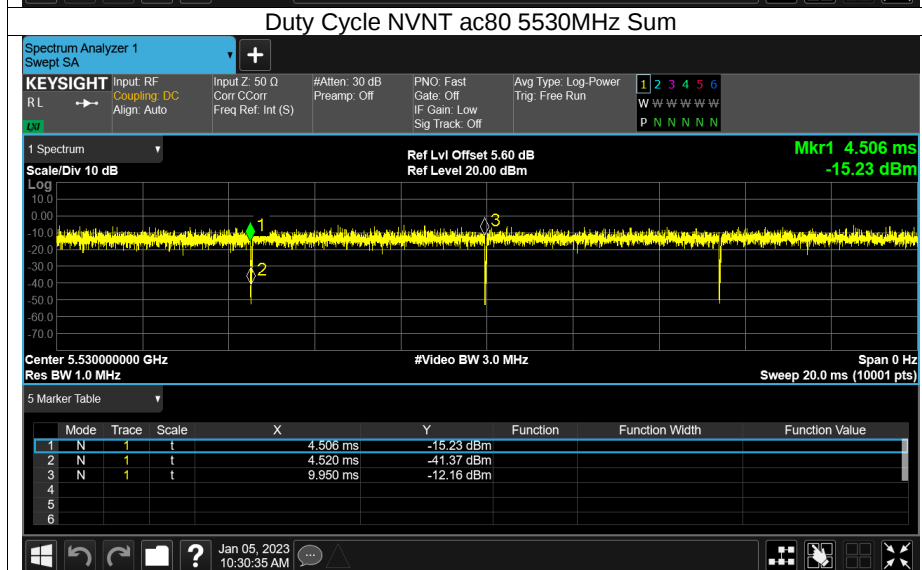
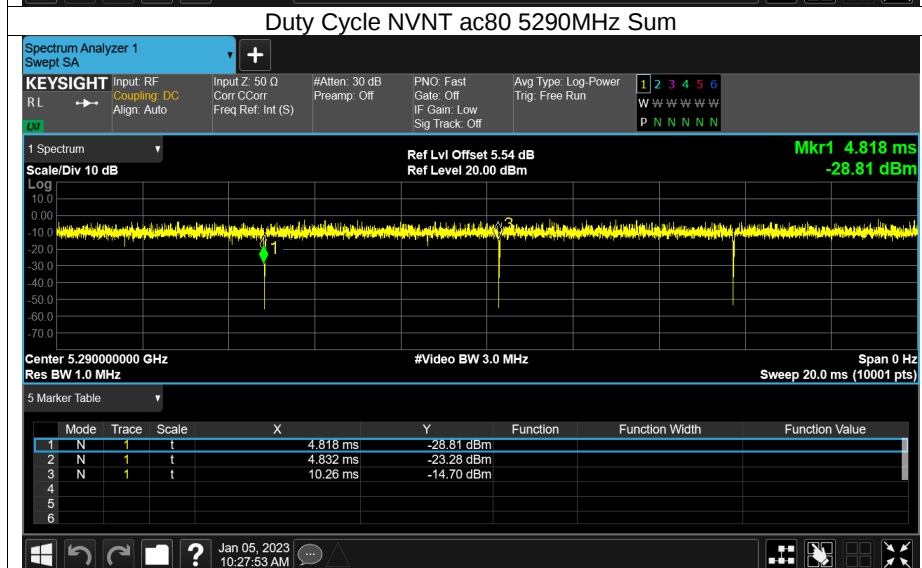
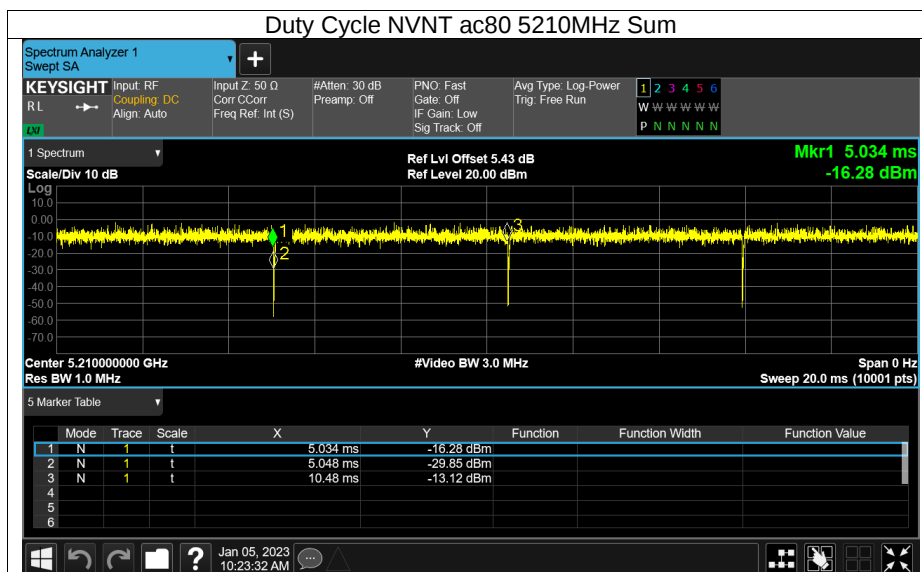


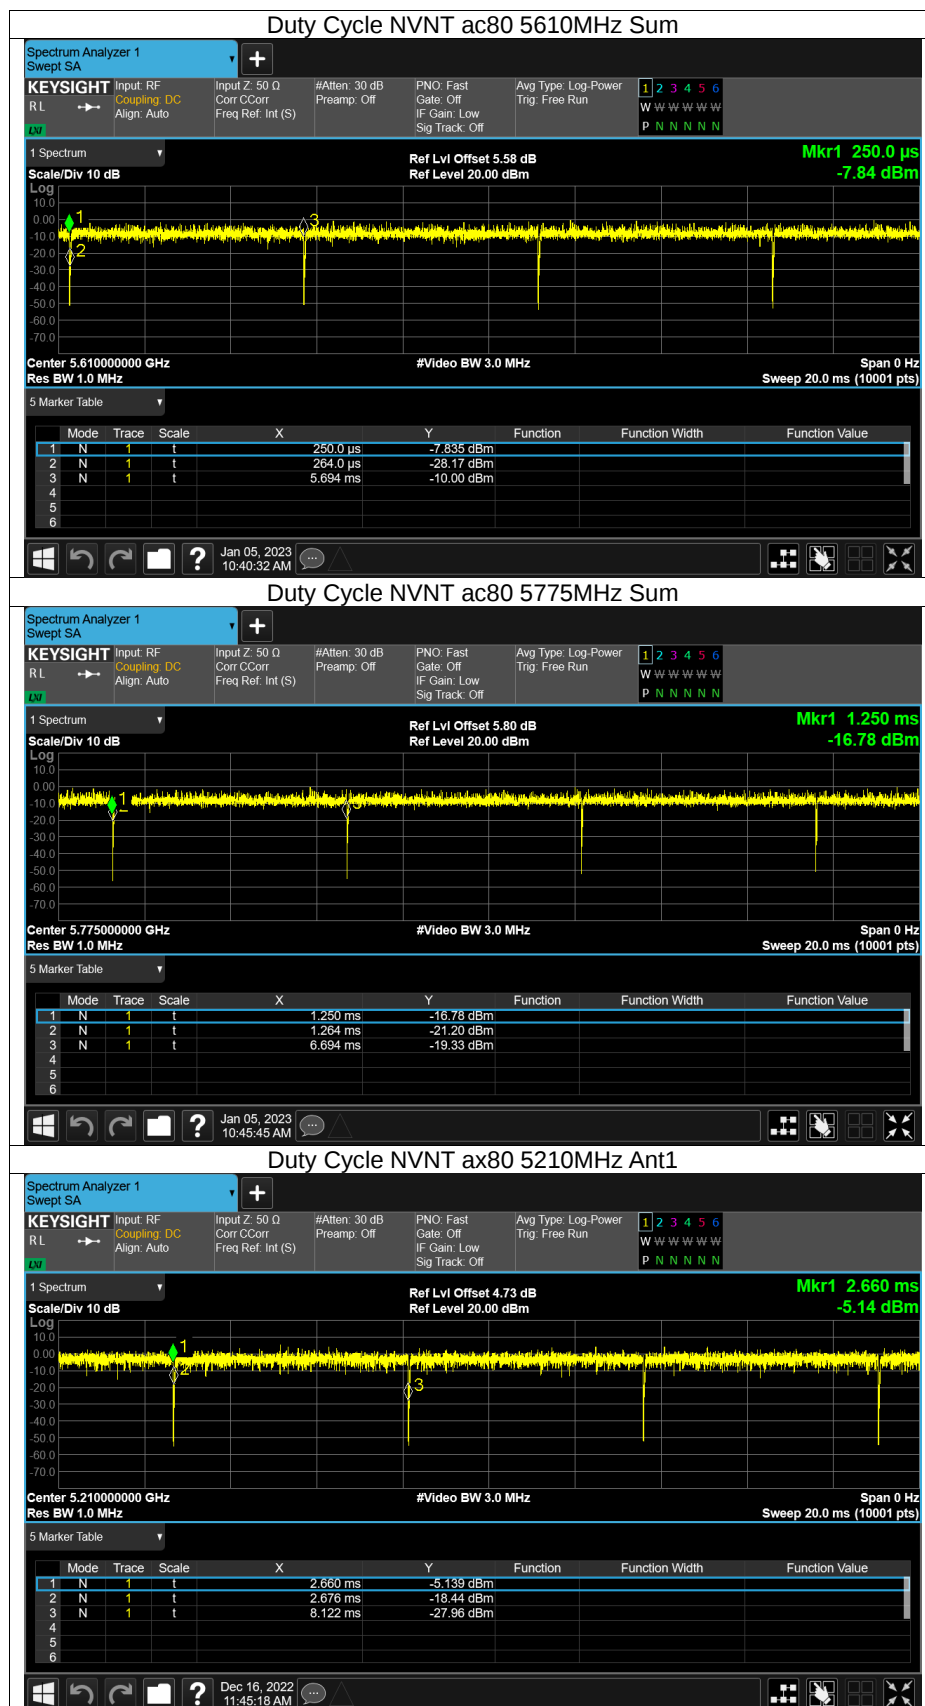


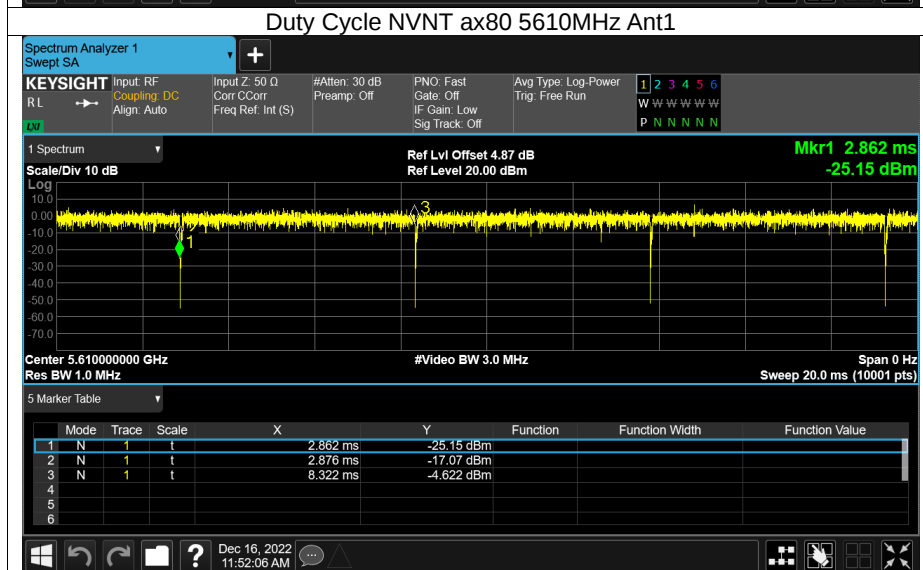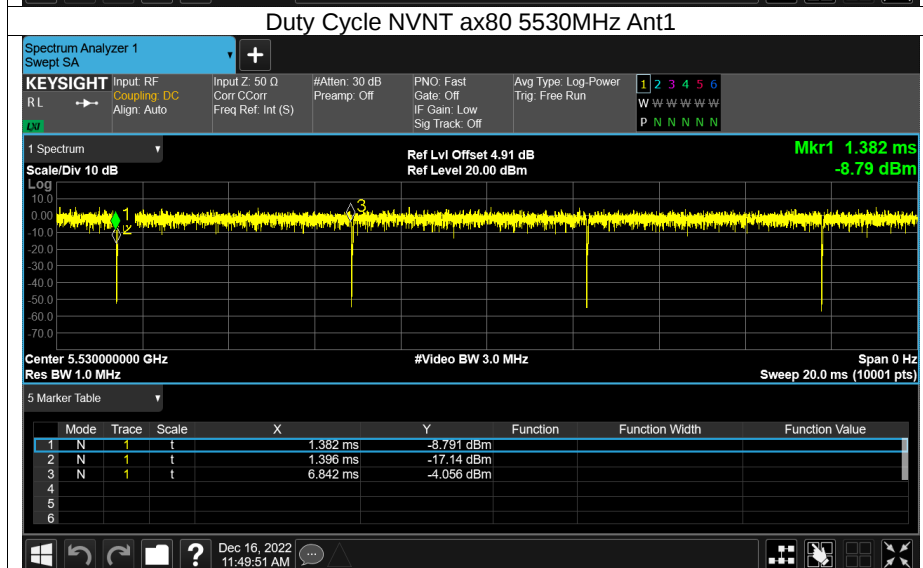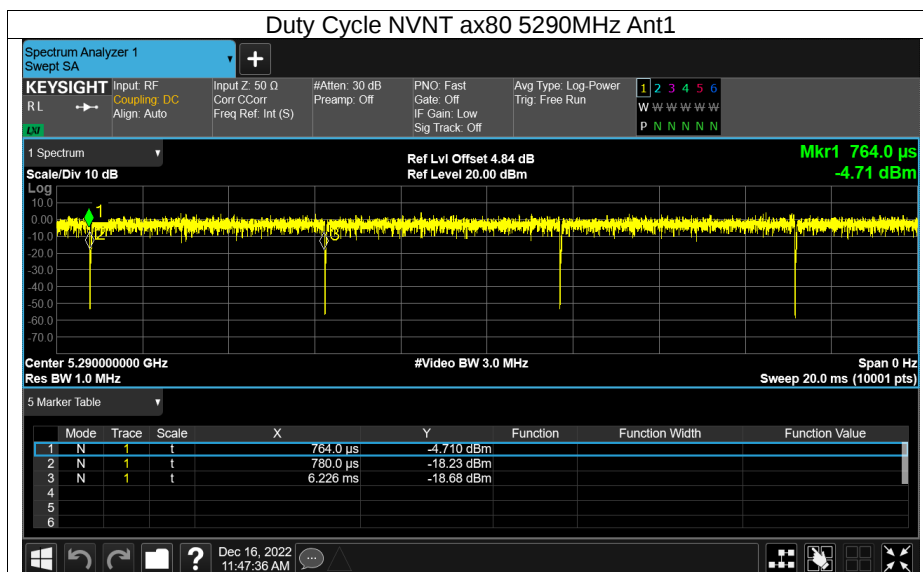

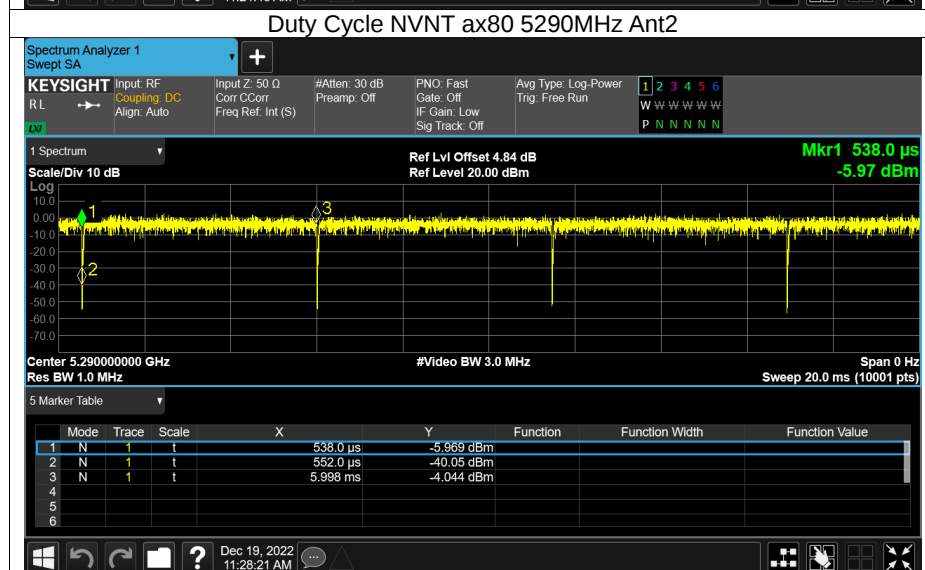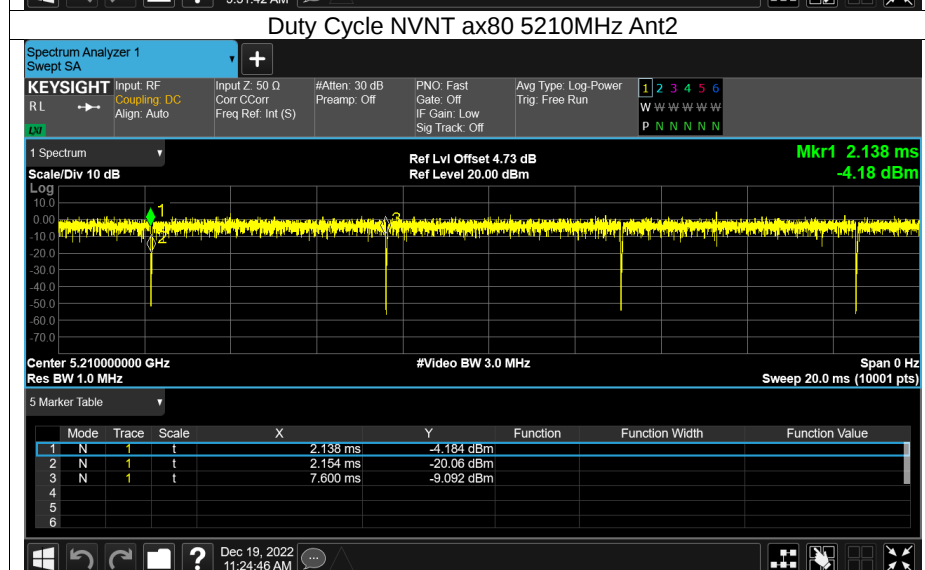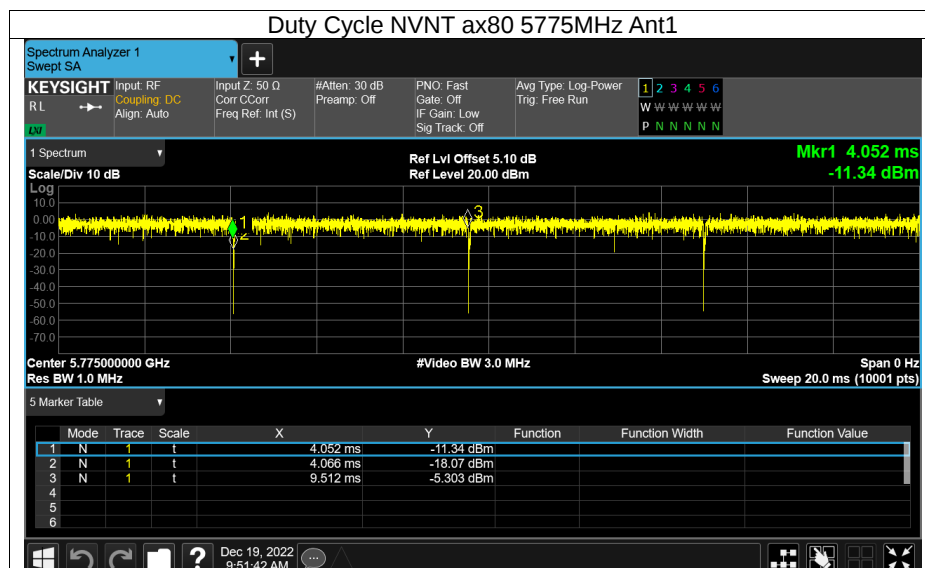

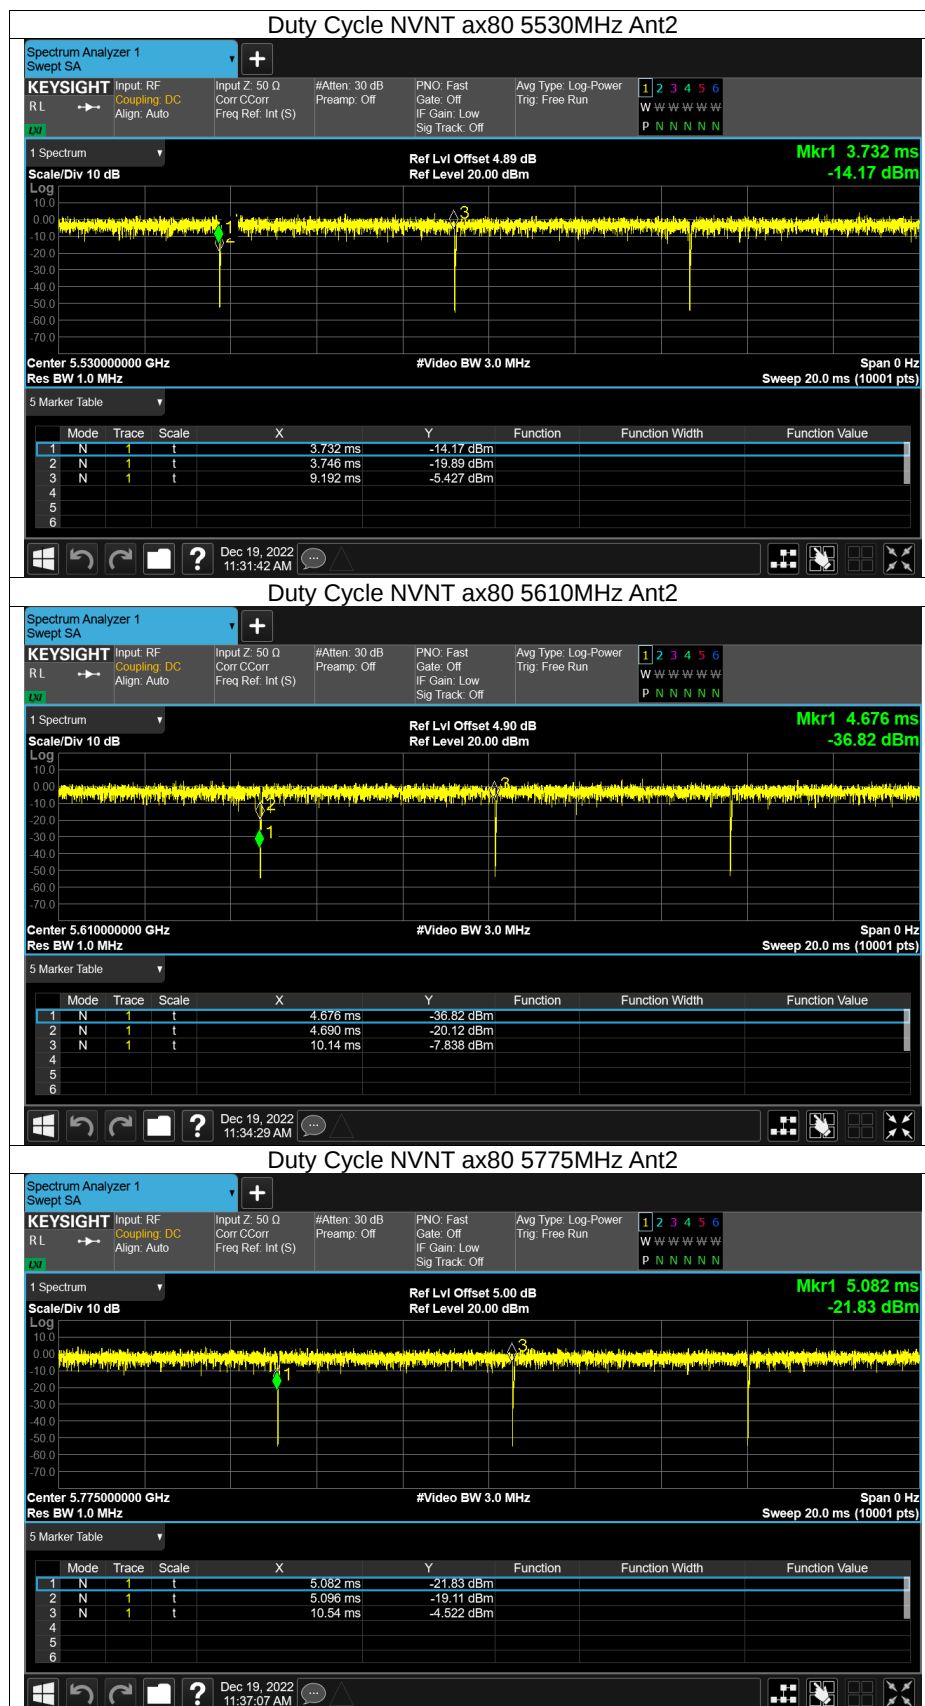

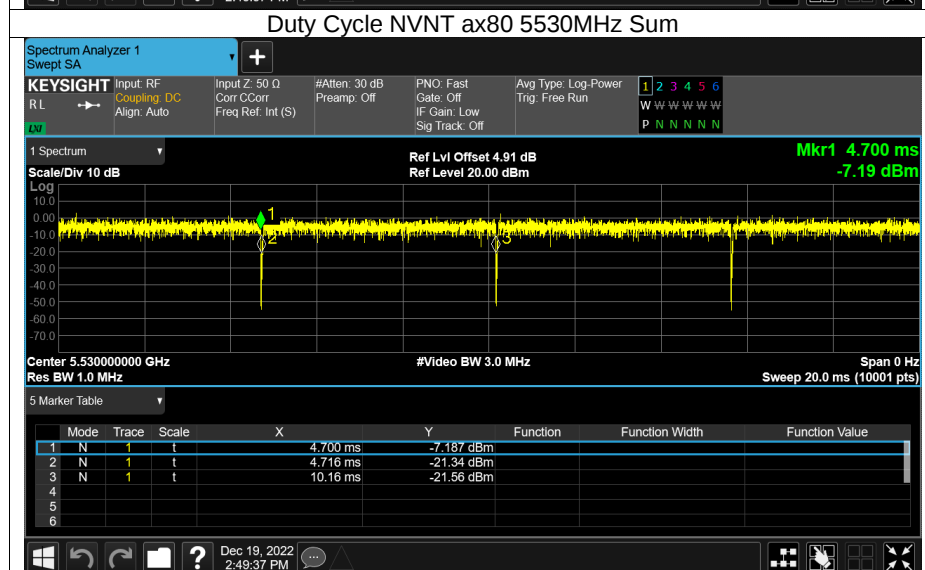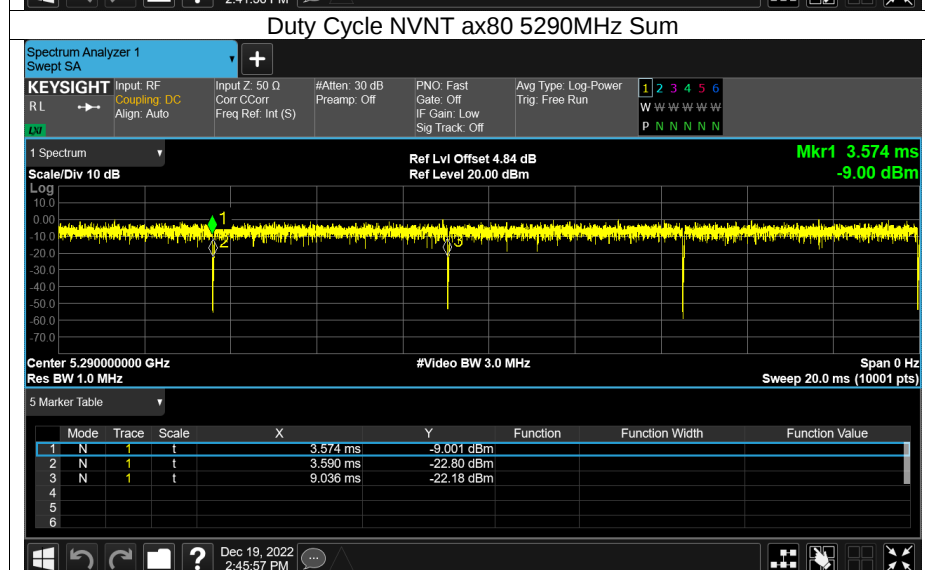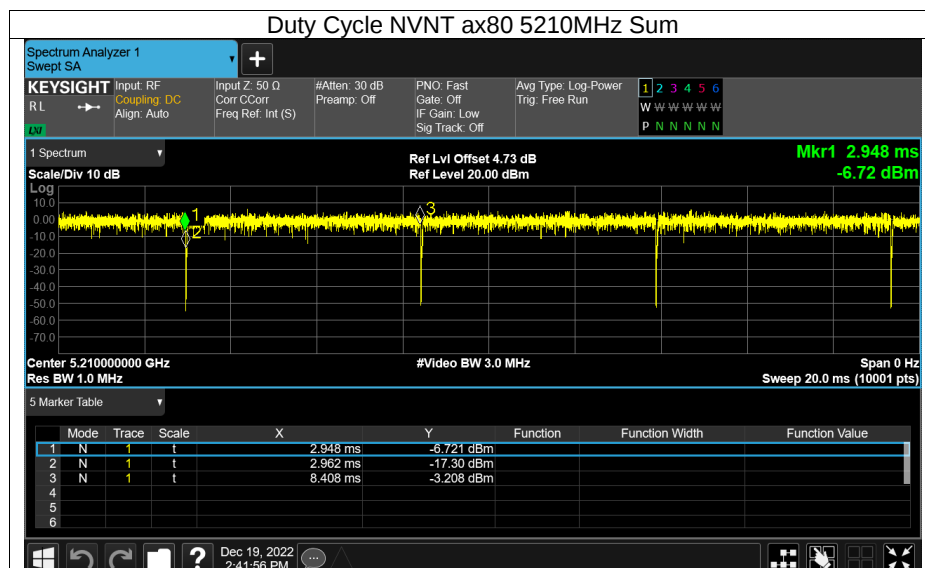

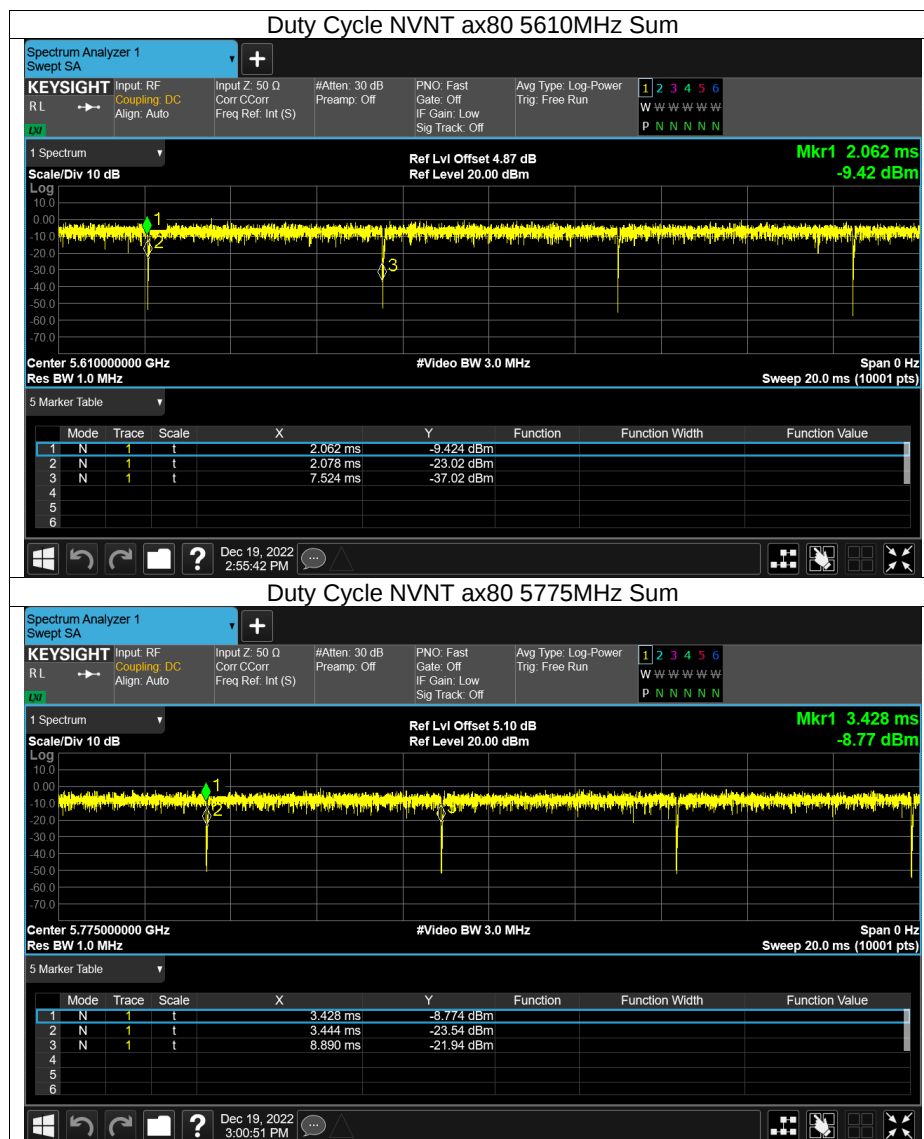



MAXIMUM CONDUCTED OUTPUT POWER

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	13.75	0	13.75	24	Pass
NVNT	a	5200	Ant1	14.17	0	14.17	24	Pass
NVNT	a	5240	Ant1	13.82	0	13.82	24	Pass
NVNT	a	5260	Ant1	13.56	0	13.56	24	Pass
NVNT	a	5300	Ant1	12.56	0	12.56	24	Pass
NVNT	a	5320	Ant1	12.92	0	12.92	24	Pass
NVNT	a	5500	Ant1	16.72	0	16.72	24	Pass
NVNT	a	5580	Ant1	15.85	0	15.85	24	Pass
NVNT	a	5700	Ant1	16.51	0	16.51	24	Pass
NVNT	a	5745	Ant1	13.46	0	13.46	30	Pass
NVNT	a	5785	Ant1	15.02	0	15.02	30	Pass
NVNT	a	5825	Ant1	14.81	0	14.81	30	Pass
NVNT	a	5180	Ant2	13.5	0	13.5	24	Pass
NVNT	a	5200	Ant2	13.79	0	13.79	24	Pass
NVNT	a	5240	Ant2	13.69	0	13.69	24	Pass
NVNT	a	5260	Ant2	12.86	0	12.86	24	Pass
NVNT	a	5300	Ant2	12.88	0	12.88	24	Pass
NVNT	a	5320	Ant2	12.49	0	12.49	24	Pass
NVNT	a	5500	Ant2	13.42	0	13.42	24	Pass
NVNT	a	5580	Ant2	12.93	0	12.93	24	Pass
NVNT	a	5700	Ant2	14.82	0	14.82	24	Pass
NVNT	a	5745	Ant2	12.76	0	12.76	30	Pass
NVNT	a	5785	Ant2	11.92	0	11.92	30	Pass
NVNT	a	5825	Ant2	10.28	0	10.28	30	Pass
NVNT	n20	5180	Ant1	14.47	0	14.47	24	Pass
NVNT	n20	5200	Ant1	13.48	0	13.48	24	Pass
NVNT	n20	5240	Ant1	13.49	0	13.49	24	Pass
NVNT	n20	5260	Ant1	13.55	0	13.55	24	Pass
NVNT	n20	5300	Ant1	13.02	0	13.02	24	Pass
NVNT	n20	5320	Ant1	12.34	0	12.34	24	Pass
NVNT	n20	5500	Ant1	14.05	0	14.05	24	Pass
NVNT	n20	5580	Ant1	14.23	0	14.23	24	Pass
NVNT	n20	5700	Ant1	14.47	0	14.47	24	Pass
NVNT	n20	5745	Ant1	15.39	0	15.39	30	Pass
NVNT	n20	5785	Ant1	15.27	0	15.27	30	Pass
NVNT	n20	5825	Ant1	15.07	0	15.07	30	Pass
NVNT	n20	5180	Ant2	13.58	0	13.58	24	Pass
NVNT	n20	5200	Ant2	13.54	0	13.54	24	Pass
NVNT	n20	5240	Ant2	13.14	0	13.14	24	Pass
NVNT	n20	5260	Ant2	12.51	0	12.51	24	Pass
NVNT	n20	5300	Ant2	12.47	0	12.47	24	Pass
NVNT	n20	5320	Ant2	12.23	0	12.23	24	Pass
NVNT	n20	5500	Ant2	12.81	0	12.81	24	Pass
NVNT	n20	5580	Ant2	12.47	0	12.47	24	Pass
NVNT	n20	5700	Ant2	14.16	0	14.16	24	Pass
NVNT	n20	5745	Ant2	14.24	0	14.24	30	Pass
NVNT	n20	5785	Ant2	13.76	0	13.76	30	Pass
NVNT	n20	5825	Ant2	10.04	0	10.04	30	Pass
NVNT	n20	5180	Ant1	7.99	0	7.99	24	Pass
NVNT	n20	5180	Ant2	8.02	0	8.02	24	Pass
NVNT	n20	5180	Sum	11.02	0	11.02	24	Pass
NVNT	n20	5200	Ant1	7.57	0	7.57	24	Pass
NVNT	n20	5200	Ant2	7.83	0	7.83	24	Pass
NVNT	n20	5200	Sum	10.71	0	10.71	24	Pass
NVNT	n20	5240	Ant1	10.85	0	10.85	24	Pass
NVNT	n20	5240	Ant2	8.74	0	8.74	24	Pass
NVNT	n20	5240	Sum	12.93	0	12.93	24	Pass
NVNT	n20	5260	Ant1	9.89	0	9.89	24	Pass
NVNT	n20	5260	Ant2	8.56	0	8.56	24	Pass
NVNT	n20	5260	Sum	12.29	0	12.29	24	Pass
NVNT	n20	5300	Ant1	9.02	0	9.02	24	Pass
NVNT	n20	5300	Ant2	8.58	0	8.58	24	Pass
NVNT	n20	5300	Sum	11.82	0	11.82	24	Pass



NVNT	n20	5320	Ant1	8.41	0	8.41	24	Pass
NVNT	n20	5320	Ant2	8.23	0	8.23	24	Pass
NVNT	n20	5320	Sum	11.33	0	11.33	24	Pass
NVNT	n20	5500	Ant1	10.15	0	10.15	24	Pass
NVNT	n20	5500	Ant2	9.25	0	9.25	24	Pass
NVNT	n20	5500	Sum	12.73	0	12.73	24	Pass
NVNT	n20	5580	Ant1	9.95	0	9.95	24	Pass
NVNT	n20	5580	Ant2	8.68	0	8.68	24	Pass
NVNT	n20	5580	Sum	12.37	0	12.37	24	Pass
NVNT	n20	5700	Ant1	9.13	0	9.13	24	Pass
NVNT	n20	5700	Ant2	10.55	0	10.55	24	Pass
NVNT	n20	5700	Sum	12.91	0	12.91	24	Pass
NVNT	n20	5745	Ant1	8.58	0	8.58	30	Pass
NVNT	n20	5745	Ant2	10.6	0	10.6	30	Pass
NVNT	n20	5745	Sum	12.72	0	12.72	30	Pass
NVNT	n20	5785	Ant1	9.64	0	9.64	30	Pass
NVNT	n20	5785	Ant2	10.85	0	10.85	30	Pass
NVNT	n20	5785	Sum	13.3	0	13.3	30	Pass
NVNT	n20	5825	Ant1	10.13	0	10.13	30	Pass
NVNT	n20	5825	Ant2	10.62	0	10.62	30	Pass
NVNT	n20	5825	Sum	13.39	0	13.39	30	Pass
NVNT	n40	5190	Ant1	14.14	0	14.14	24	Pass
NVNT	n40	5230	Ant1	13.94	0	13.94	24	Pass
NVNT	n40	5270	Ant1	11.39	0	11.39	24	Pass
NVNT	n40	5310	Ant1	11.26	0	11.26	24	Pass
NVNT	n40	5510	Ant1	14.1	0	14.1	24	Pass
NVNT	n40	5550	Ant1	14.08	0	14.08	24	Pass
NVNT	n40	5670	Ant1	15.02	0	15.02	24	Pass
NVNT	n40	5755	Ant1	15.91	0	15.91	30	Pass
NVNT	n40	5795	Ant1	15.71	0	15.71	30	Pass
NVNT	n40	5190	Ant2	14.32	0	14.32	24	Pass
NVNT	n40	5230	Ant2	14.01	0	14.01	24	Pass
NVNT	n40	5270	Ant2	13.31	0	13.31	24	Pass
NVNT	n40	5300	Ant2	13.25	0	13.25	24	Pass
NVNT	n40	5310	Ant2	12.58	0	12.58	24	Pass
NVNT	n40	5510	Ant2	12.85	0	12.85	24	Pass
NVNT	n40	5550	Ant2	12.83	0	12.83	24	Pass
NVNT	n40	5670	Ant2	11.23	0	11.23	24	Pass
NVNT	n40	5755	Ant2	13	0	13	30	Pass
NVNT	n40	5795	Ant2	11.96	0	11.96	30	Pass
NVNT	n40	5190	Ant1	7.53	0	7.53	24	Pass
NVNT	n40	5190	Ant2	7.58	0	7.58	24	Pass
NVNT	n40	5190	Sum	10.57	0	10.57	24	Pass
NVNT	n40	5230	Ant1	10.79	0	10.79	24	Pass
NVNT	n40	5230	Ant2	9.7	0	9.7	24	Pass
NVNT	n40	5230	Sum	13.29	0	13.29	24	Pass
NVNT	n40	5270	Ant1	10.2	0	10.2	24	Pass
NVNT	n40	5270	Ant2	9.01	0	9.01	24	Pass
NVNT	n40	5270	Sum	12.66	0	12.66	24	Pass
NVNT	n40	5300	Ant1	9.84	0	9.84	24	Pass
NVNT	n40	5300	Ant2	9.31	0	9.31	24	Pass
NVNT	n40	5300	Sum	12.59	0	12.59	24	Pass
NVNT	n40	5310	Ant1	9.02	0	9.02	24	Pass
NVNT	n40	5310	Ant2	8.76	0	8.76	24	Pass
NVNT	n40	5310	Sum	11.9	0	11.9	24	Pass
NVNT	n40	5510	Ant1	10.78	0	10.78	24	Pass
NVNT	n40	5510	Ant2	9.6	0	9.6	24	Pass
NVNT	n40	5510	Sum	13.24	0	13.24	24	Pass
NVNT	n40	5550	Ant1	10.98	0	10.98	24	Pass
NVNT	n40	5550	Ant2	9.51	0	9.51	24	Pass
NVNT	n40	5550	Sum	13.32	0	13.32	24	Pass
NVNT	n40	5670	Ant1	8.32	0	8.32	24	Pass
NVNT	n40	5670	Ant2	10.93	0	10.93	24	Pass
NVNT	n40	5670	Sum	12.83	0	12.83	24	Pass
NVNT	n40	5755	Ant1	9.41	0	9.41	30	Pass
NVNT	n40	5755	Ant2	11.96	0	11.96	30	Pass
NVNT	n40	5755	Sum	13.88	0	13.88	30	Pass
NVNT	n40	5795	Ant1	9.3	0	9.3	30	Pass



NVNT	n40	5795	Ant2	10.88	0	10.88	30	Pass
NVNT	n40	5795	Sum	13.17	0	13.17	30	Pass
NVNT	ac80	5210	Ant1	12.5	0	12.5	24	Pass
NVNT	ac80	5290	Ant1	12.13	0	12.13	24	Pass
NVNT	ac80	5530	Ant1	13.02	0	13.02	24	Pass
NVNT	ac80	5610	Ant1	13.18	0	13.18	24	Pass
NVNT	ac80	5775	Ant1	13.76	0	13.76	30	Pass
NVNT	ac80	5210	Ant2	15.54	0	15.54	24	Pass
NVNT	ac80	5290	Ant2	11.36	0	11.36	24	Pass
NVNT	ac80	5530	Ant2	10.72	0	10.72	24	Pass
NVNT	ac80	5610	Ant2	9.26	0	9.26	24	Pass
NVNT	ac80	5775	Ant2	11.8	0	11.8	30	Pass
NVNT	ac80	5210	Ant1	7.69	0	7.69	24	Pass
NVNT	ac80	5210	Ant2	8.28	0	8.28	24	Pass
NVNT	ac80	5210	Sum	11.01	0	11.01	24	Pass
NVNT	ac80	5290	Ant1	5.22	0	5.22	24	Pass
NVNT	ac80	5290	Ant2	6.05	0	6.05	24	Pass
NVNT	ac80	5290	Sum	8.67	0	8.67	24	Pass
NVNT	ac80	5530	Ant1	6.98	0	6.98	24	Pass
NVNT	ac80	5530	Ant2	5.41	0	5.41	24	Pass
NVNT	ac80	5530	Sum	9.28	0	9.28	24	Pass
NVNT	ac80	5610	Ant1	5.9	0	5.9	24	Pass
NVNT	ac80	5610	Ant2	5.07	0	5.07	24	Pass
NVNT	ac80	5610	Sum	8.52	0	8.52	24	Pass
NVNT	ac80	5775	Ant1	7.24	0	7.24	30	Pass
NVNT	ac80	5775	Ant2	8.46	0	8.46	30	Pass
NVNT	ac80	5775	Sum	10.9	0	10.9	30	Pass
NVNT	ax80	5210	Ant1	13.54	0	13.54	24	Pass
NVNT	ax80	5290	Ant1	13.56	0	13.56	24	Pass
NVNT	ax80	5530	Ant1	14.2	0	14.2	24	Pass
NVNT	ax80	5610	Ant1	14.28	0	14.28	24	Pass
NVNT	ax80	5775	Ant1	14.05	0	14.05	30	Pass
NVNT	ax80	5210	Ant2	12.86	0	12.86	24	Pass
NVNT	ax80	5290	Ant2	12.81	0	12.81	24	Pass
NVNT	ax80	5530	Ant2	12.7	0	12.7	24	Pass
NVNT	ax80	5610	Ant2	13.13	0	13.13	24	Pass
NVNT	ax80	5775	Ant2	14.84	0	14.84	30	Pass
NVNT	ax80	5210	Ant1	7.49	0	7.49	24	Pass
NVNT	ax80	5210	Ant2	6.7	0	6.7	24	Pass
NVNT	ax80	5210	Sum	10.12	0	10.12	24	Pass
NVNT	ax80	5290	Ant1	9.38	0	9.38	24	Pass
NVNT	ax80	5290	Ant2	9.05	0	9.05	24	Pass
NVNT	ax80	5290	Sum	12.23	0	12.23	24	Pass
NVNT	ax80	5530	Ant1	10.56	0	10.56	24	Pass
NVNT	ax80	5530	Ant2	9.47	0	9.47	24	Pass
NVNT	ax80	5530	Sum	13.06	0	13.06	24	Pass
NVNT	ax80	5610	Ant1	9.19	0	9.19	24	Pass
NVNT	ax80	5610	Ant2	9.56	0	9.56	24	Pass
NVNT	ax80	5610	Sum	12.39	0	12.39	24	Pass
NVNT	ax80	5775	Ant1	8.42	0	8.42	30	Pass
NVNT	ax80	5775	Ant2	11.17	0	11.17	30	Pass
NVNT	ax80	5775	Sum	13.02	0	13.02	30	Pass



