




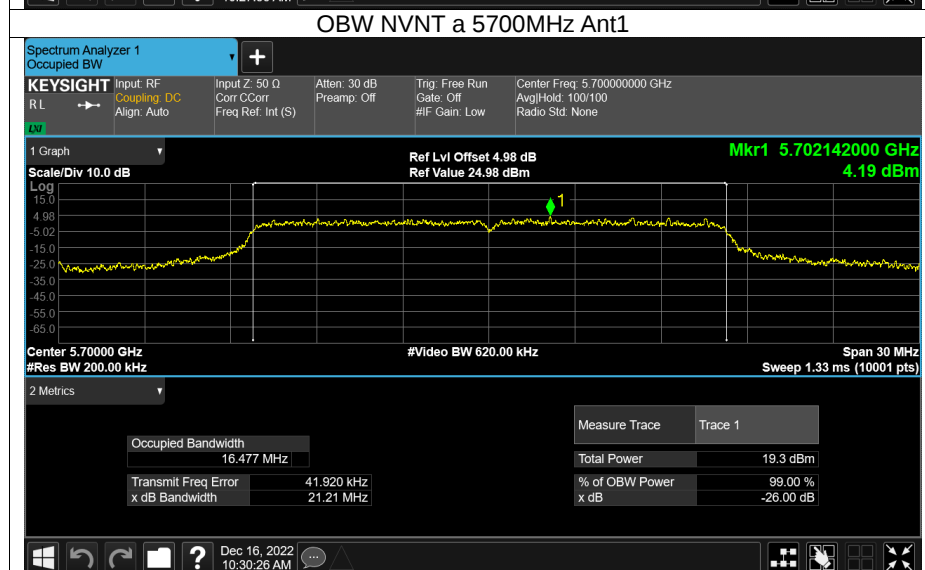


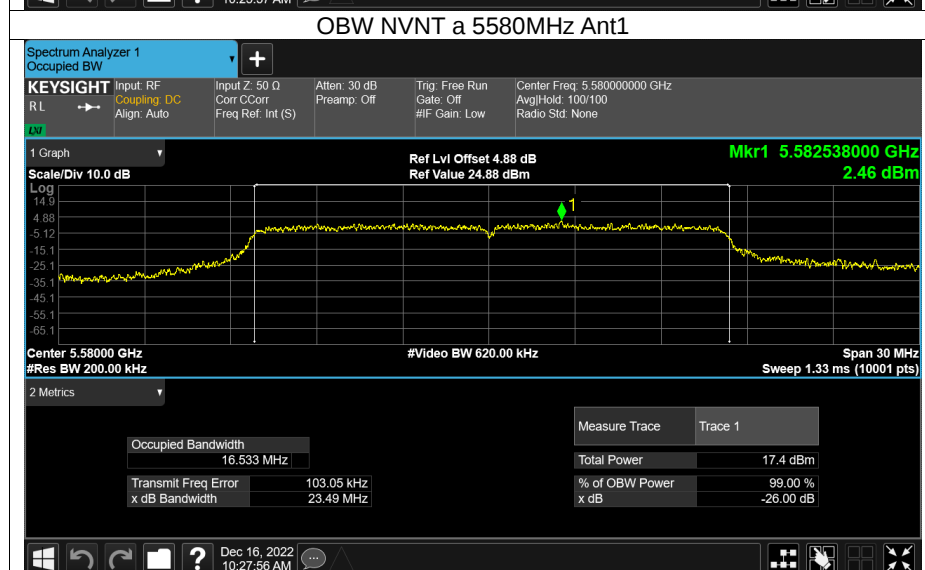



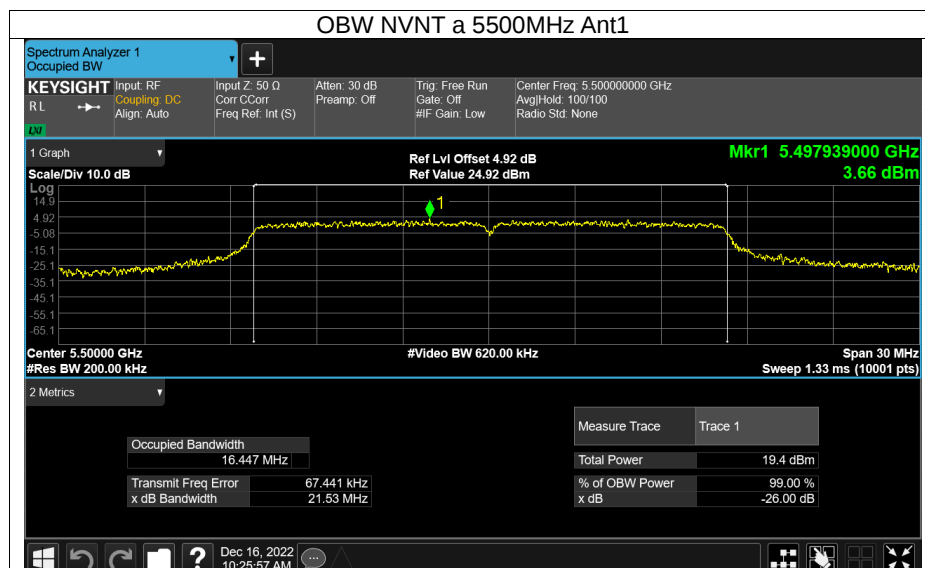




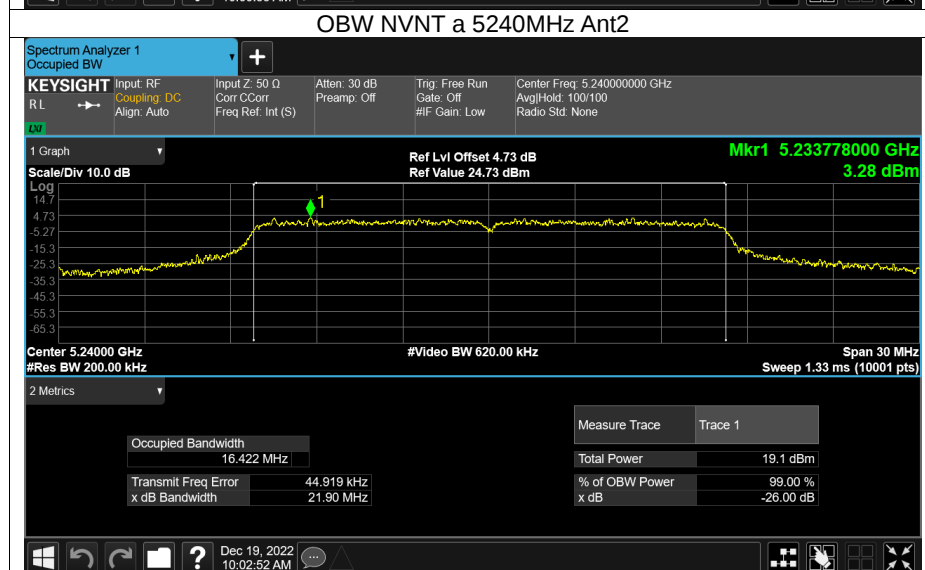




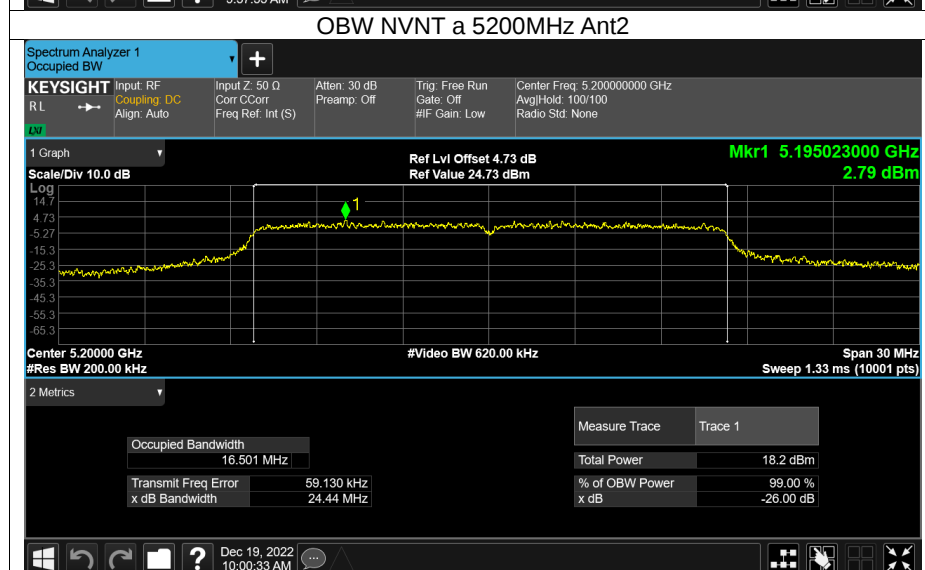




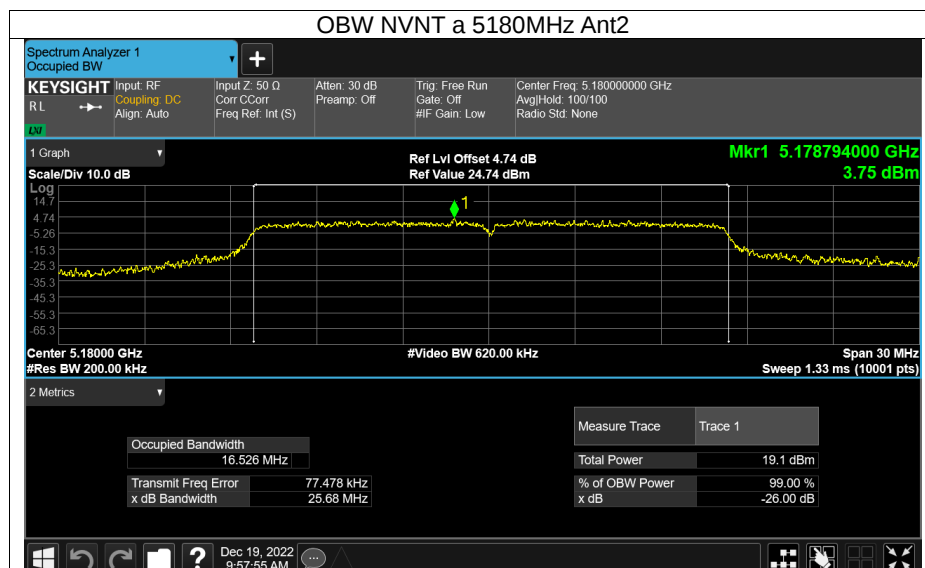







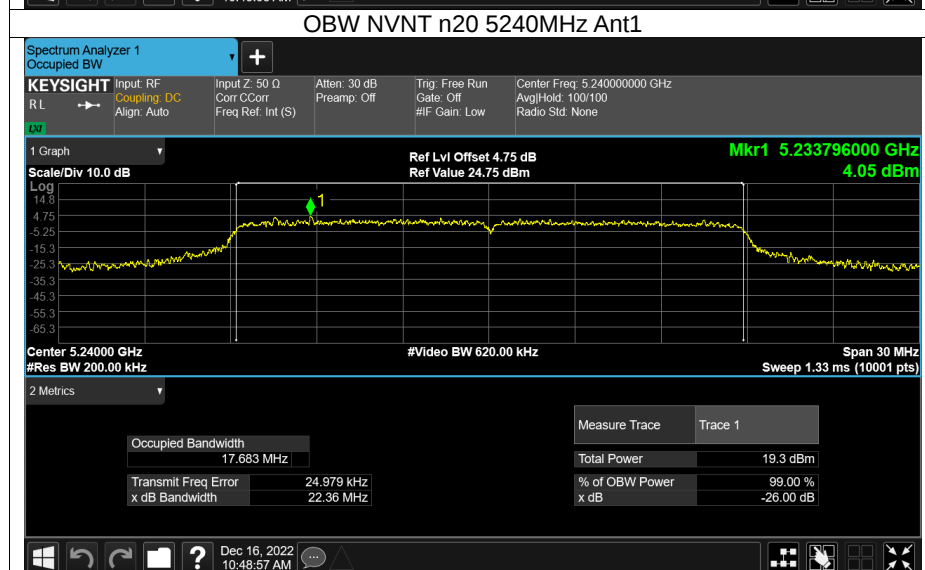
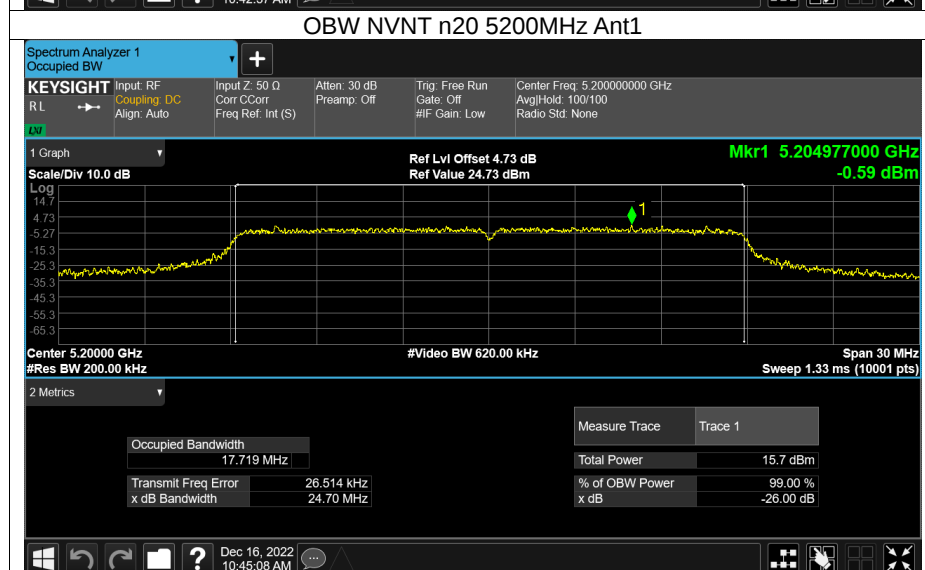
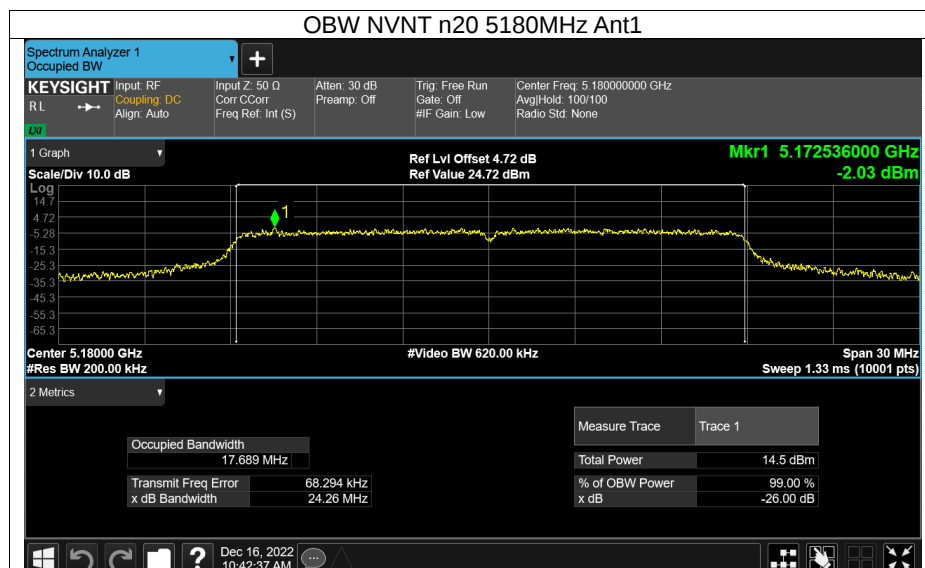


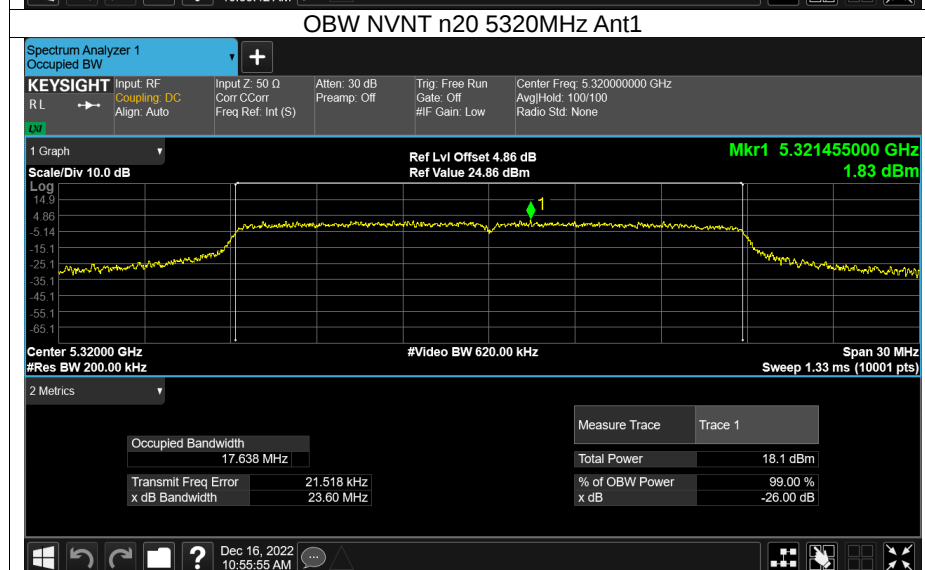
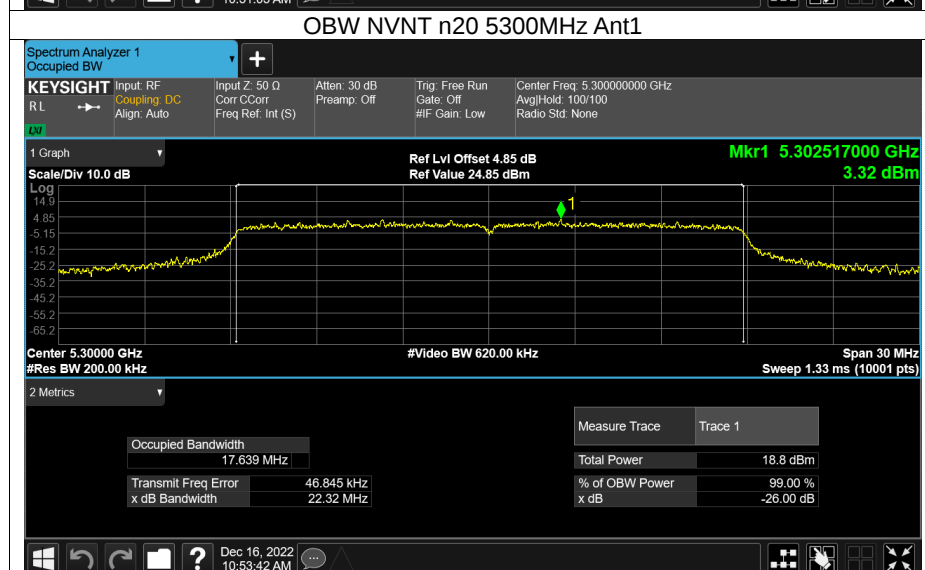
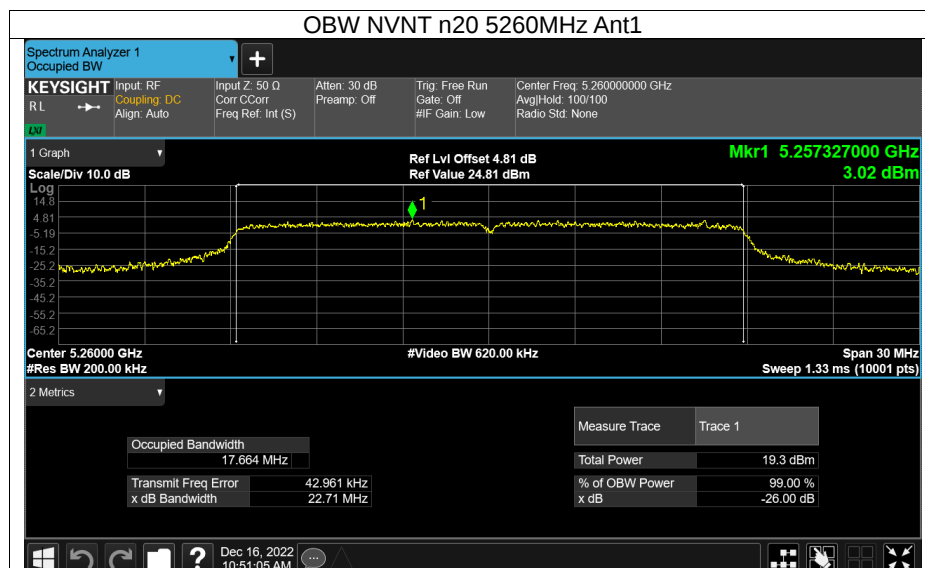


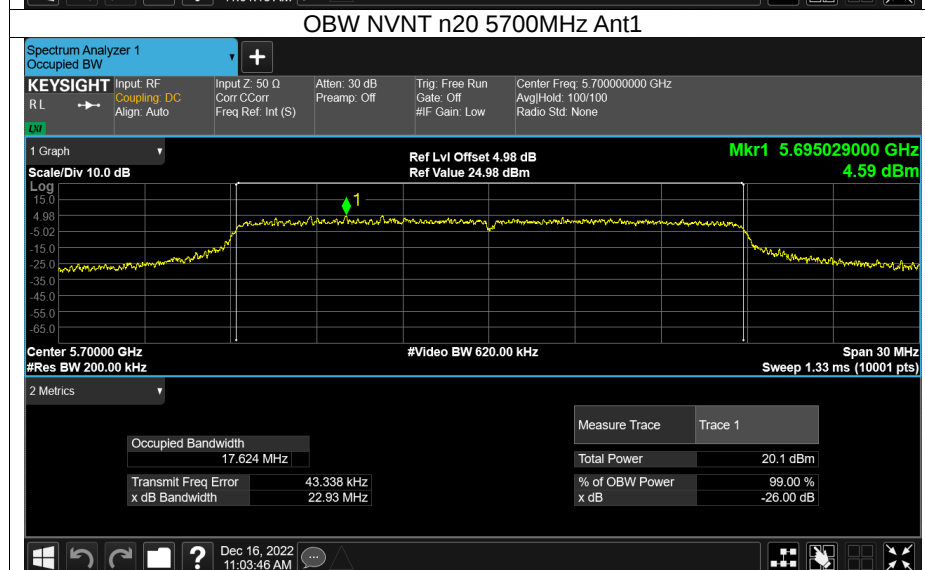
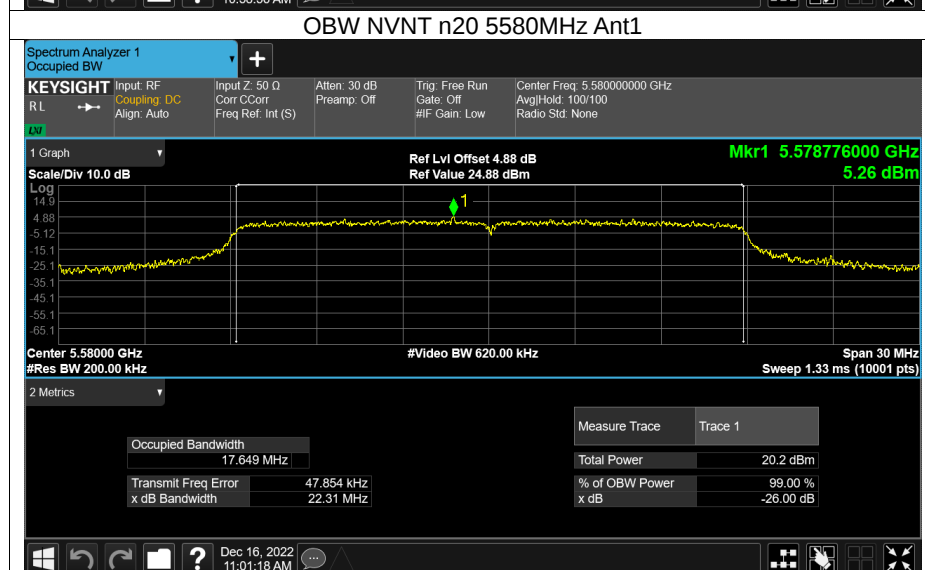
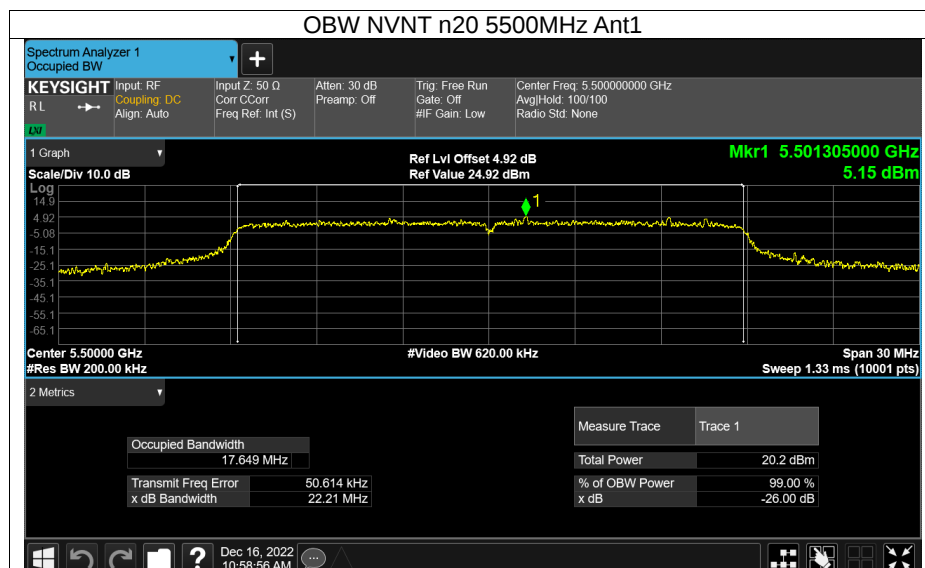


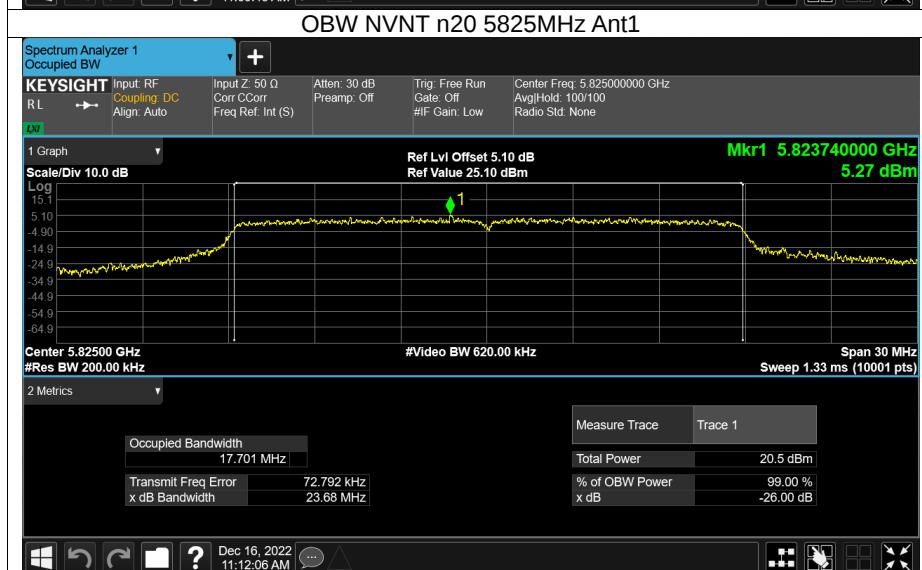
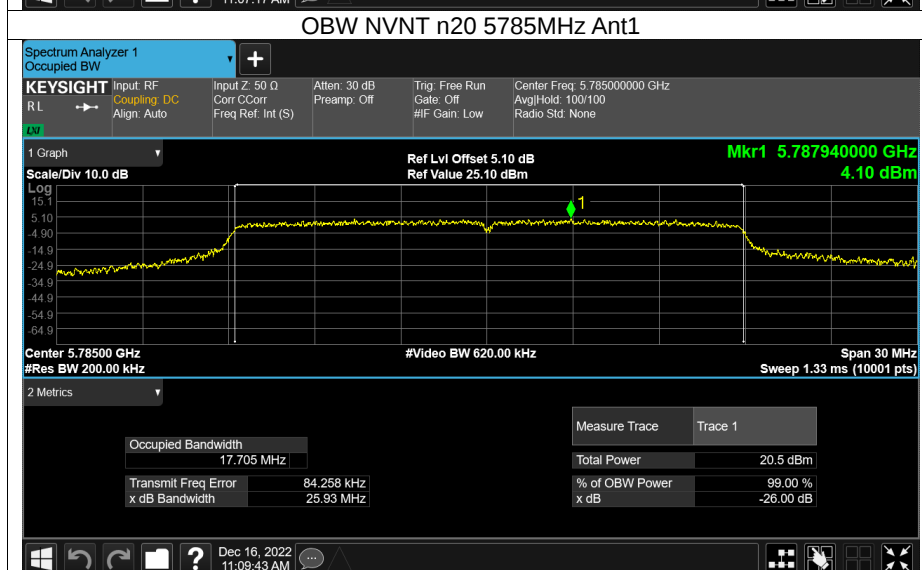
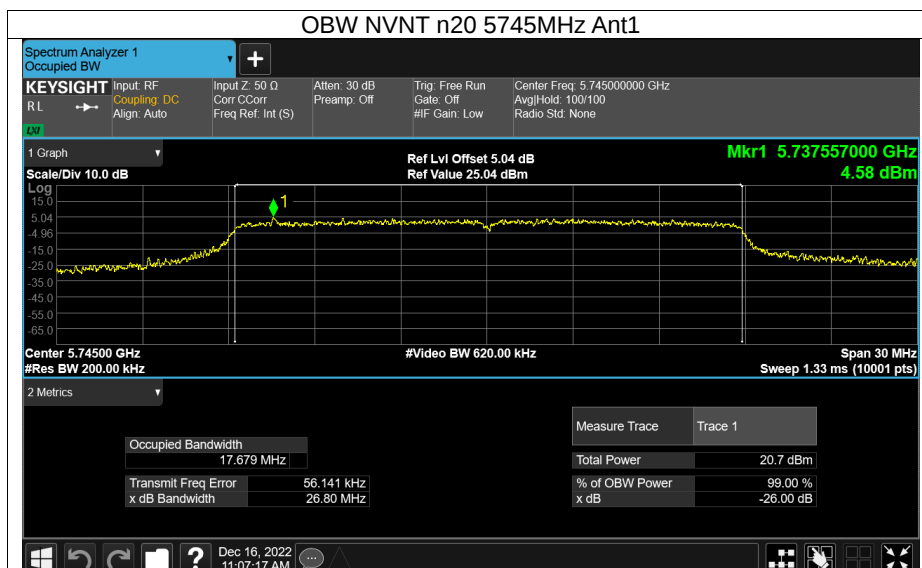


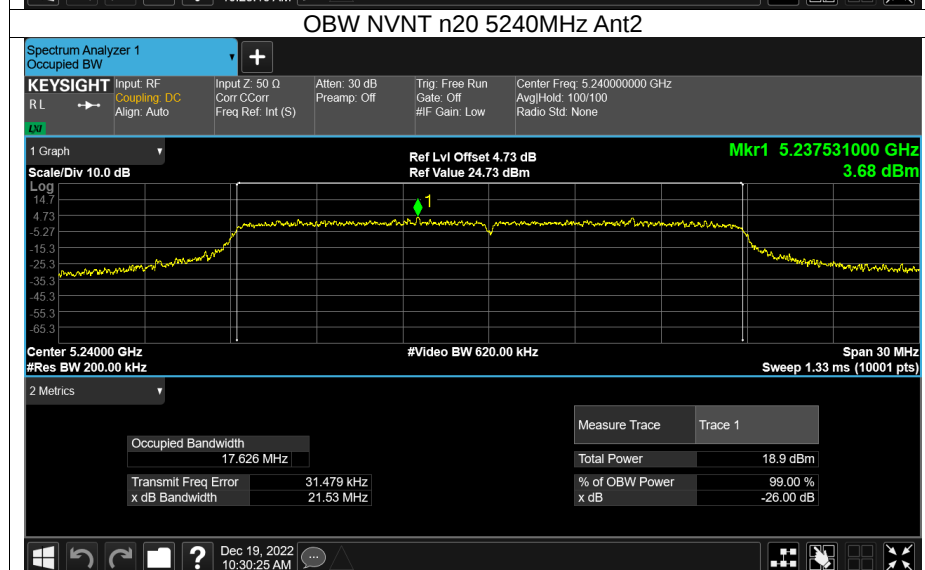
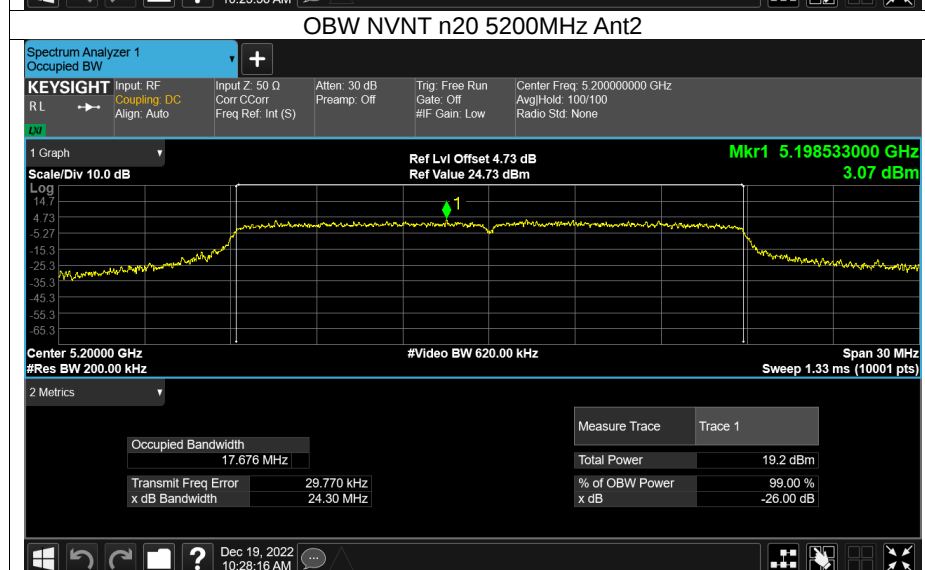
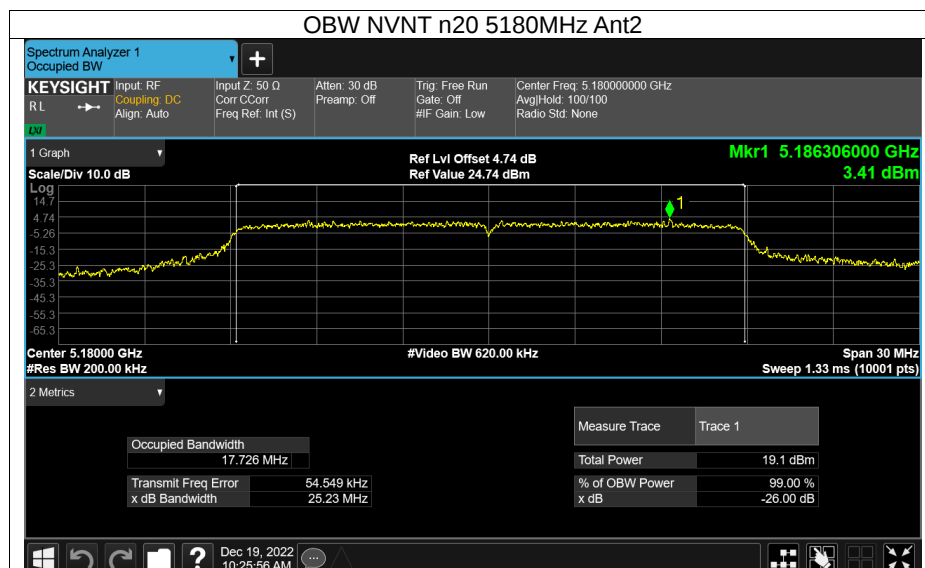


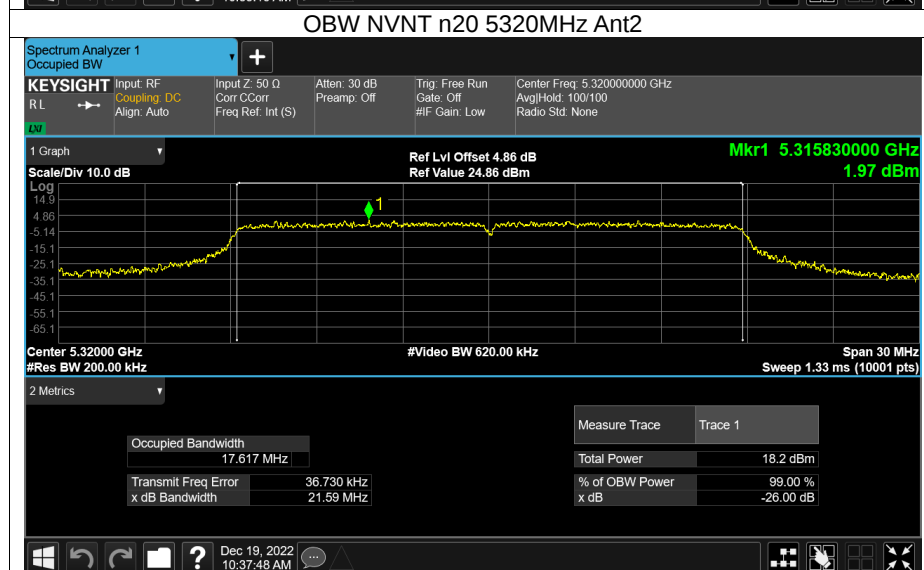
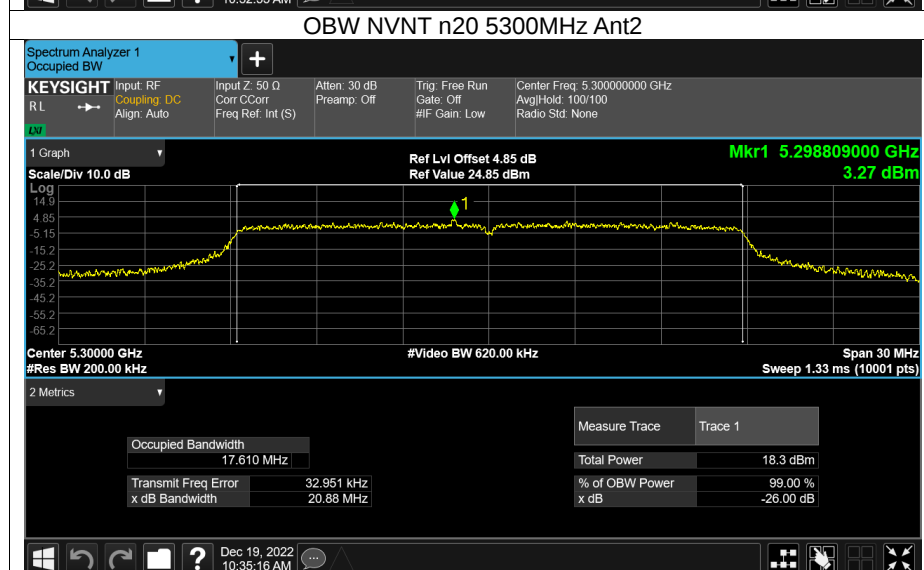
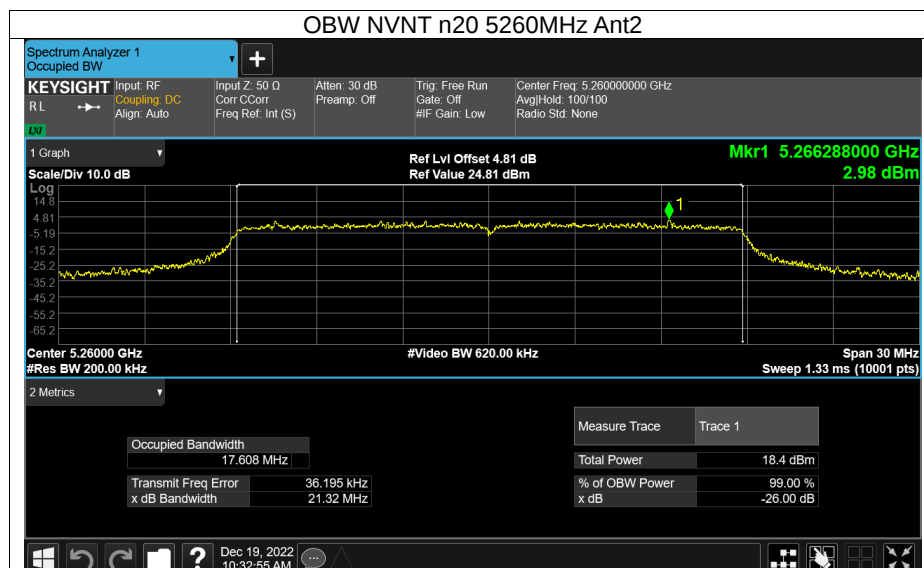


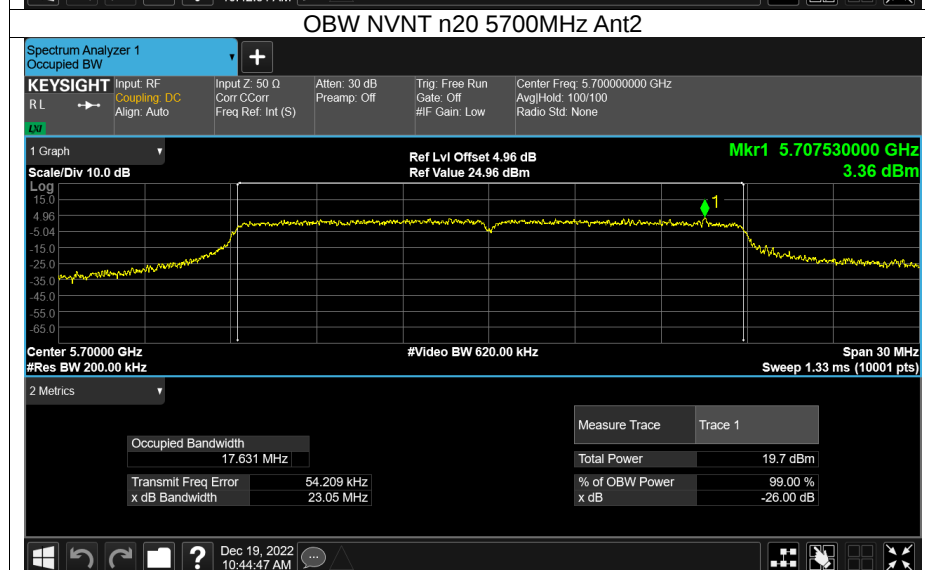
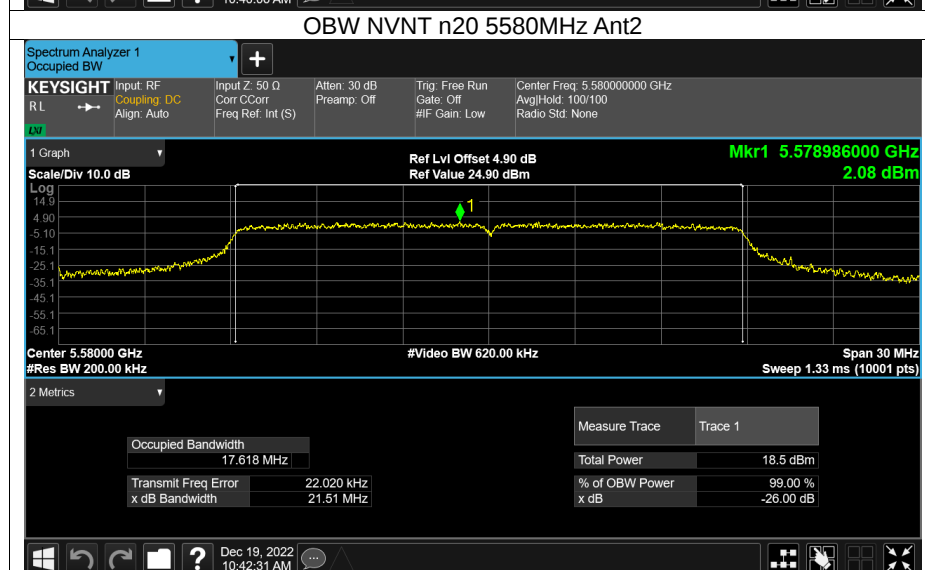
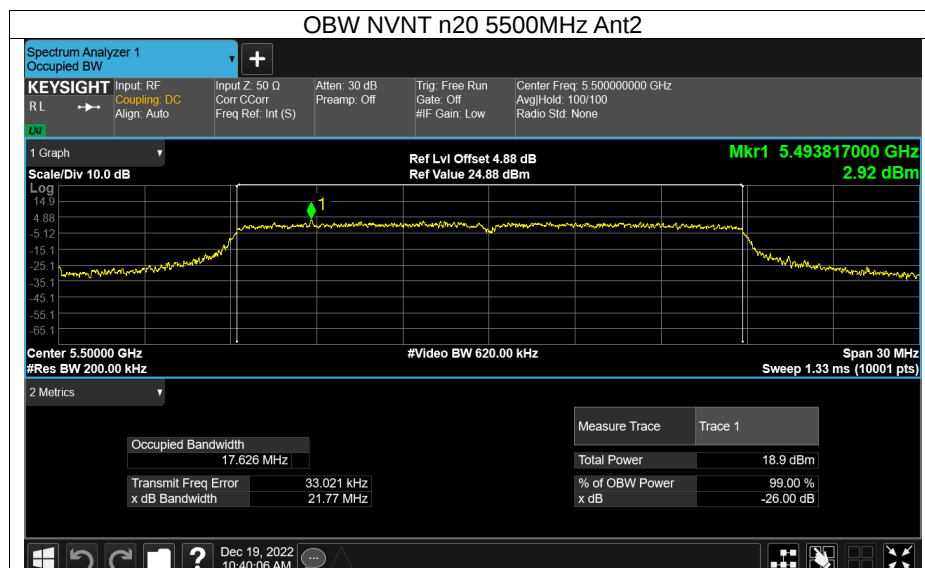


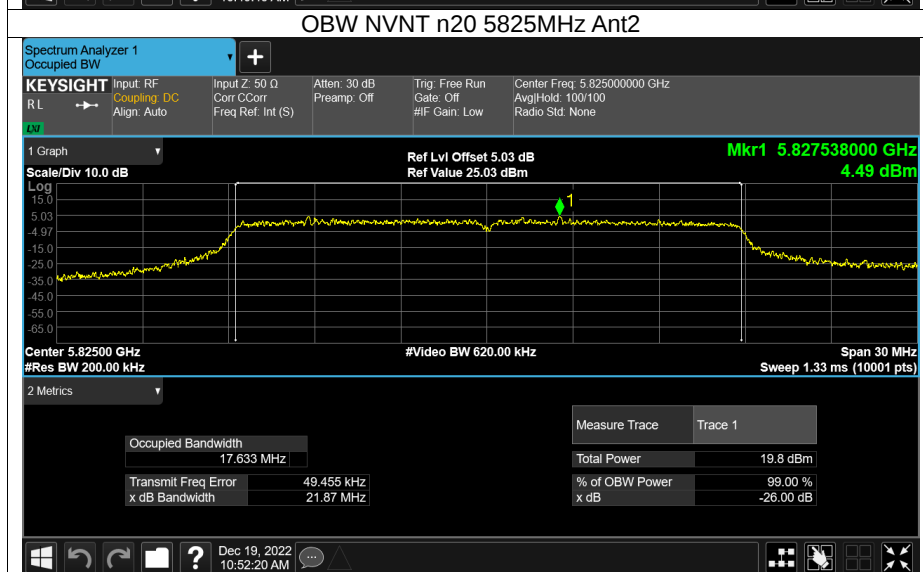
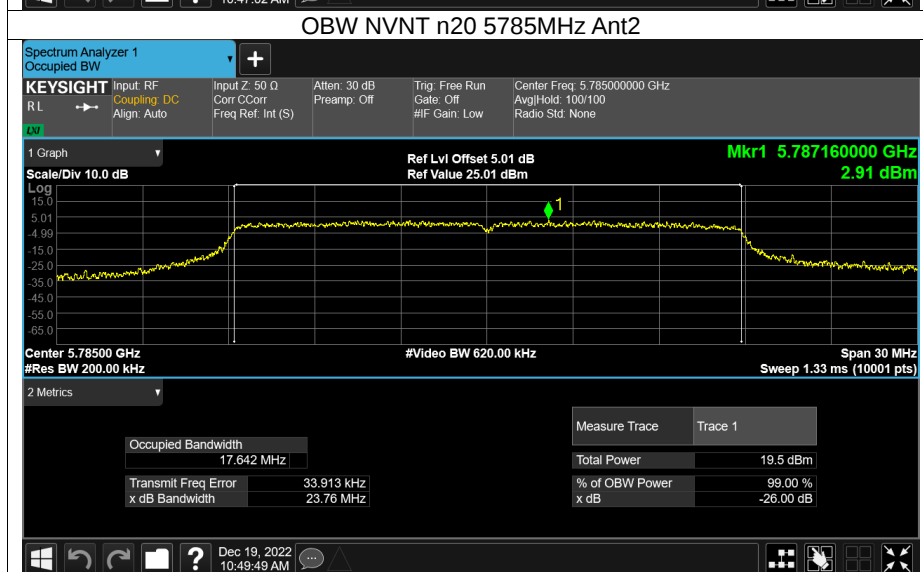
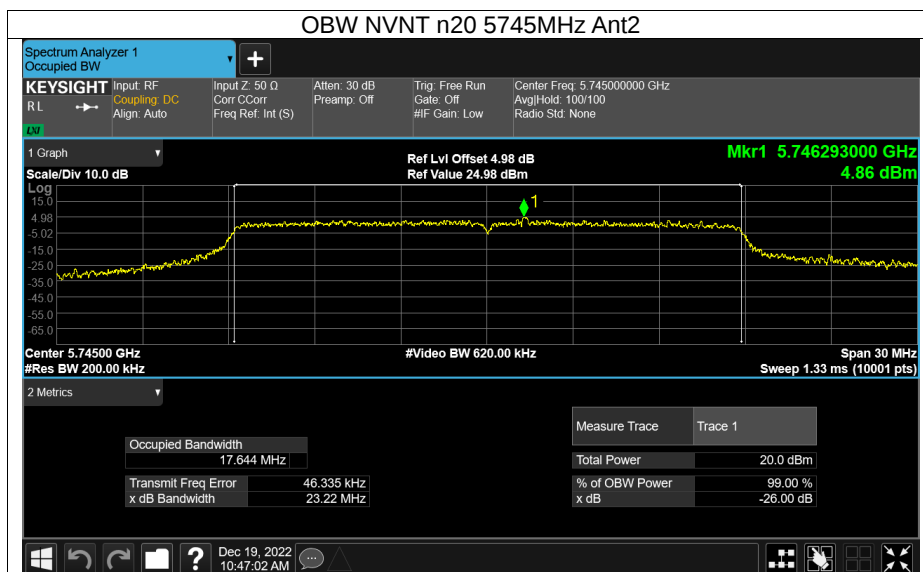


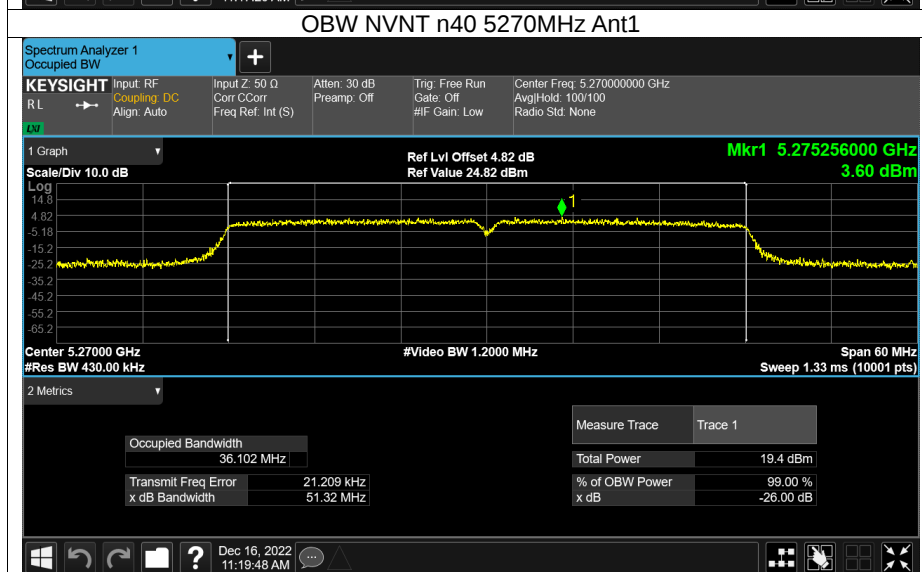
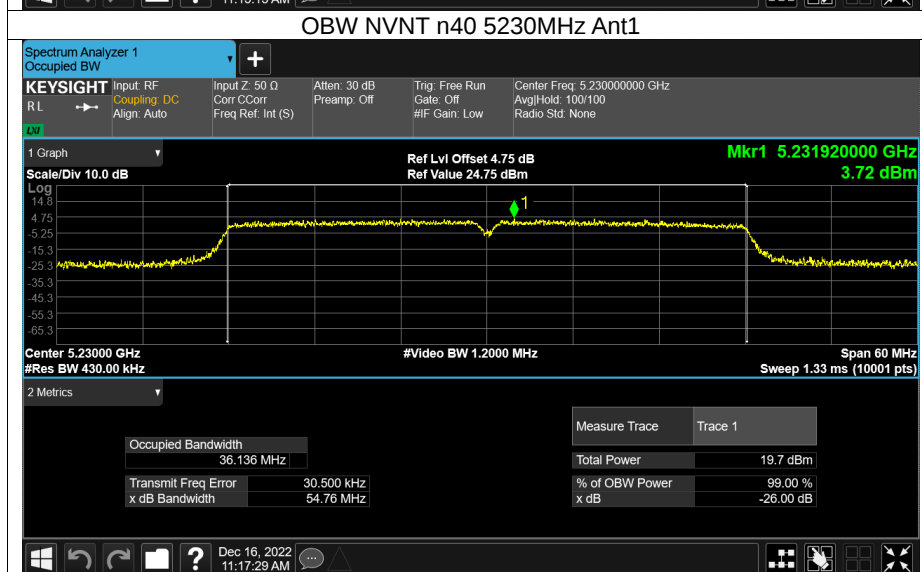
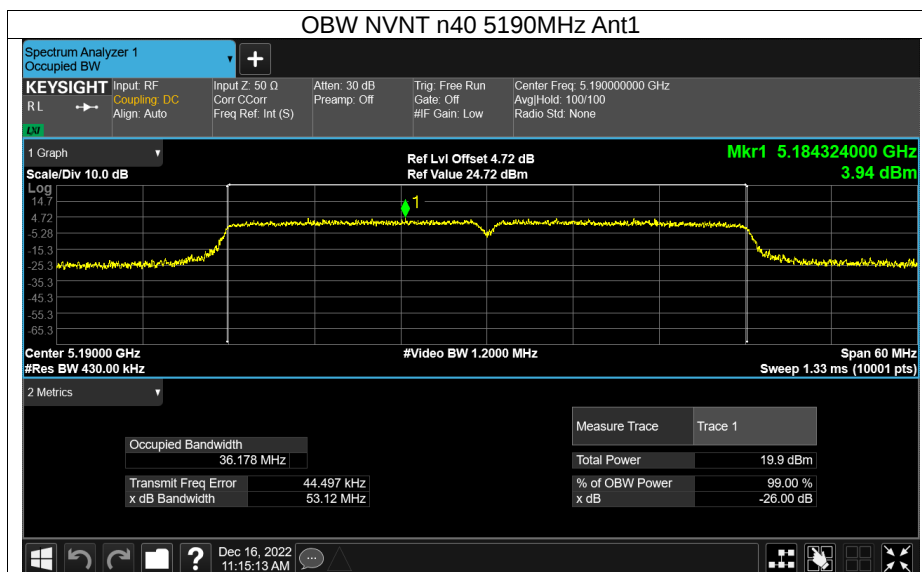


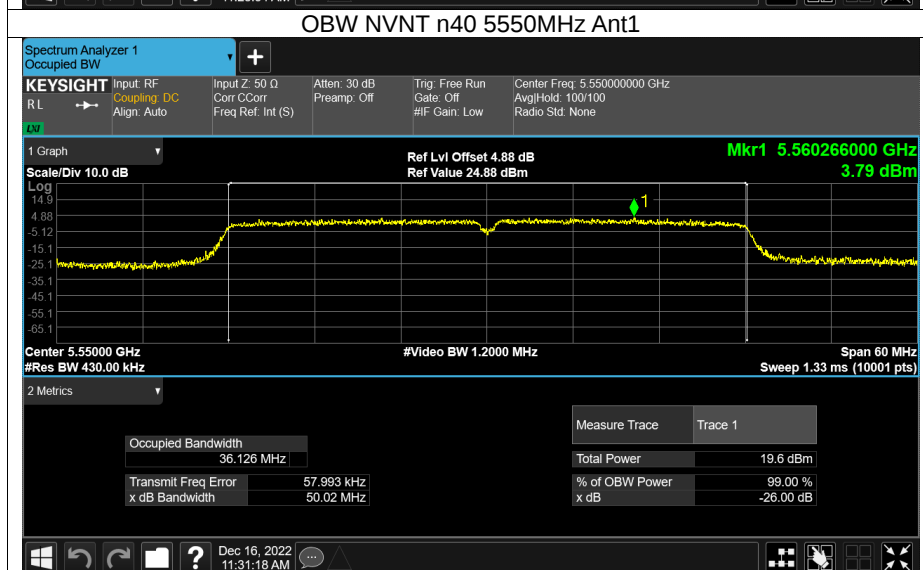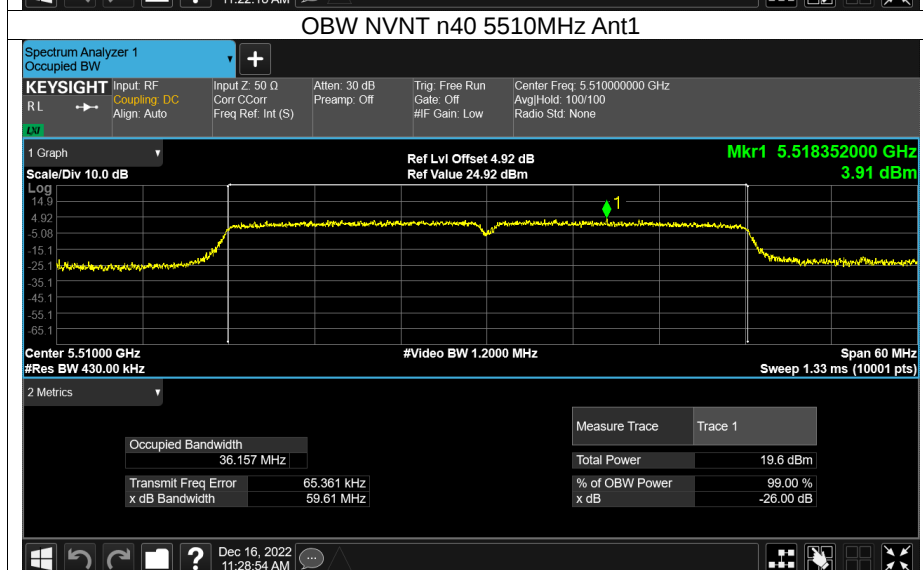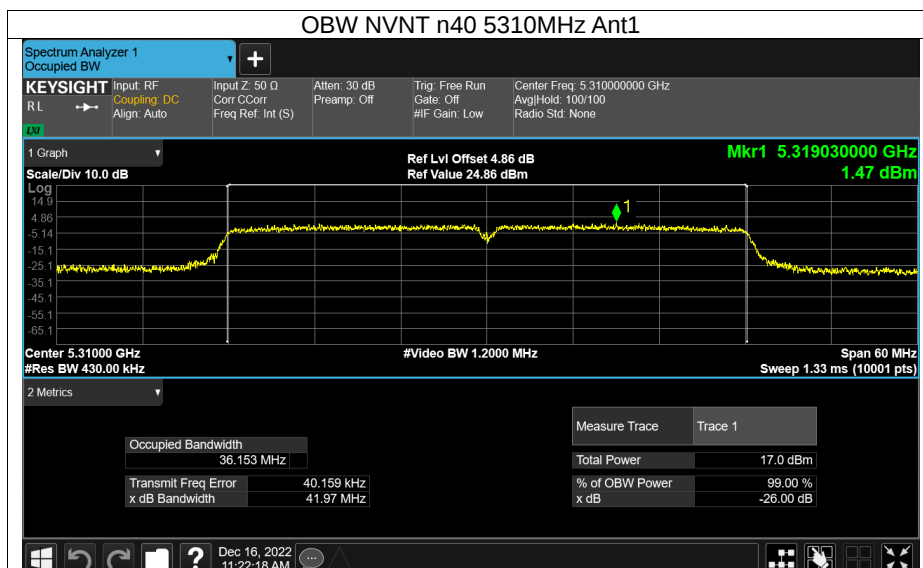


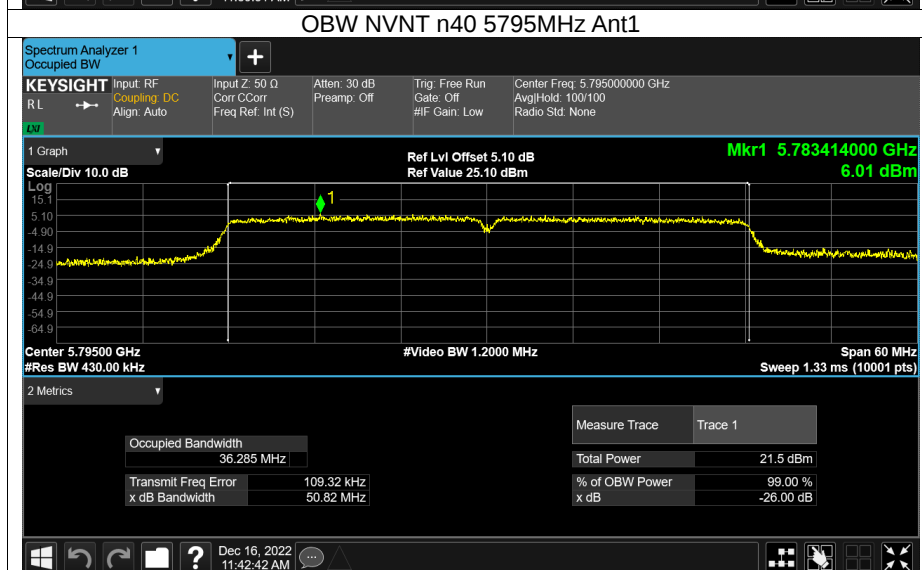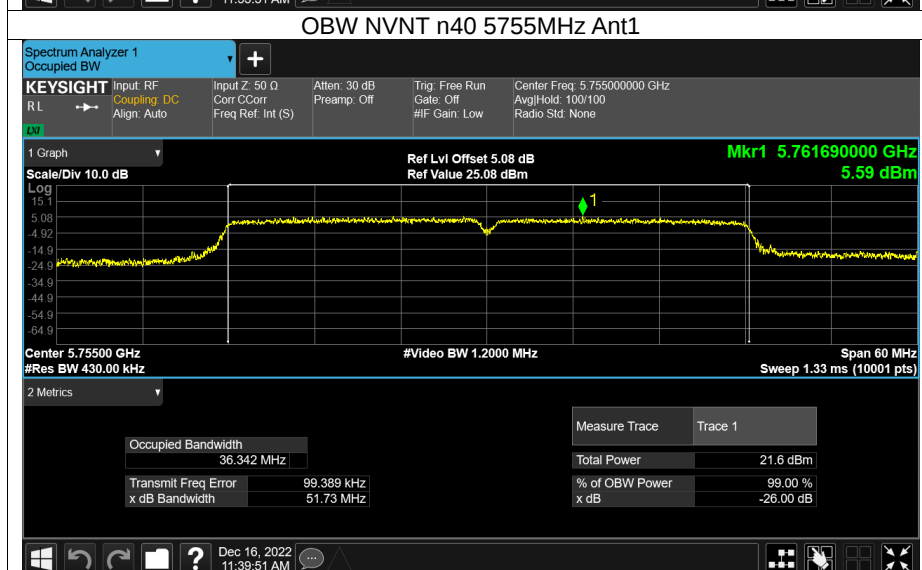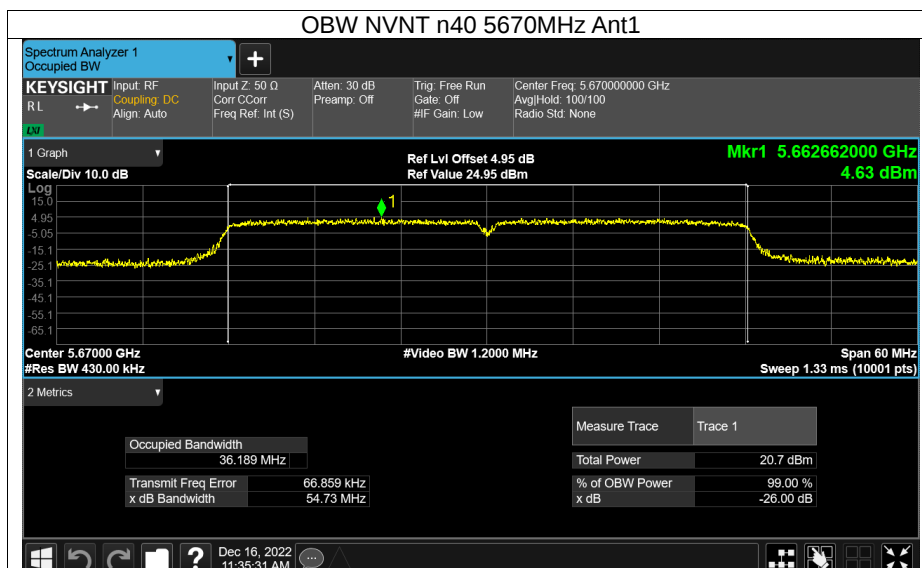


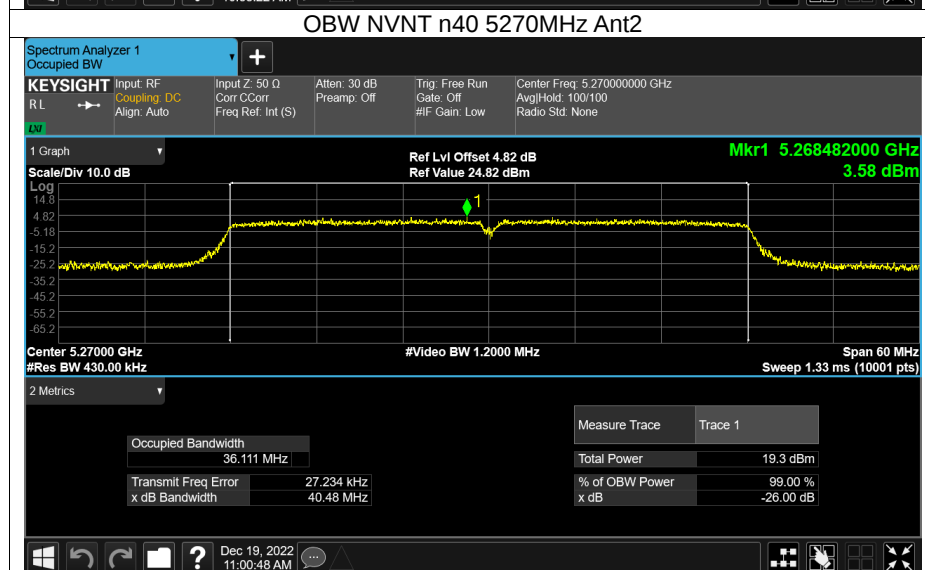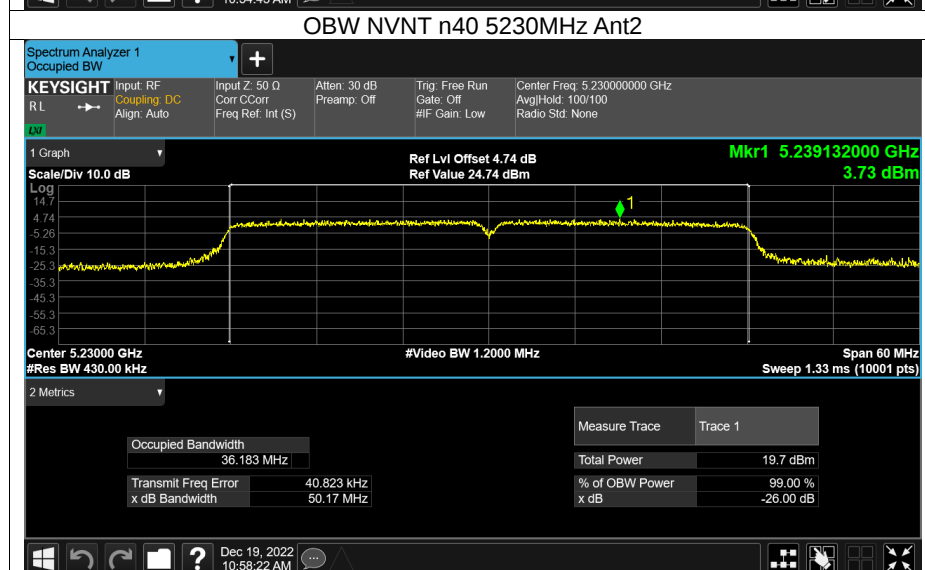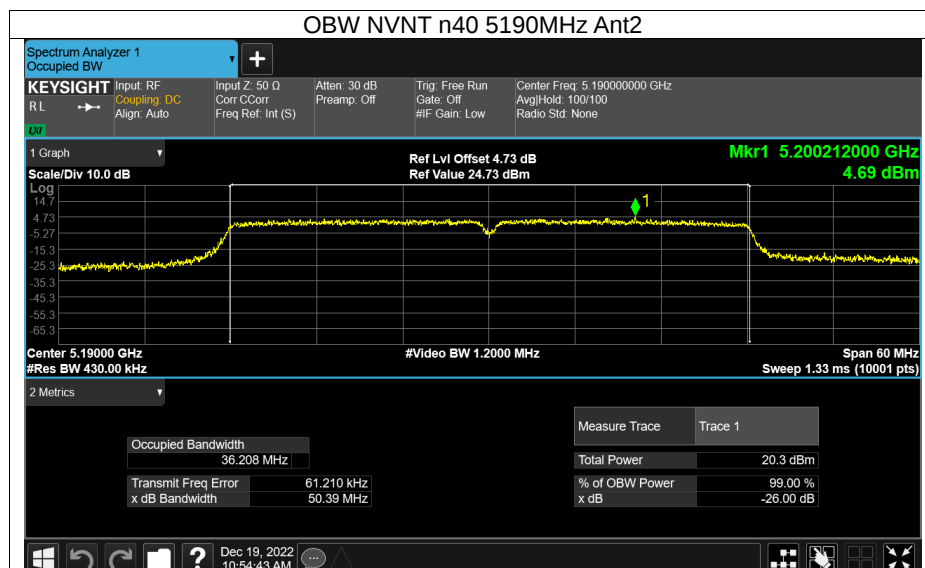


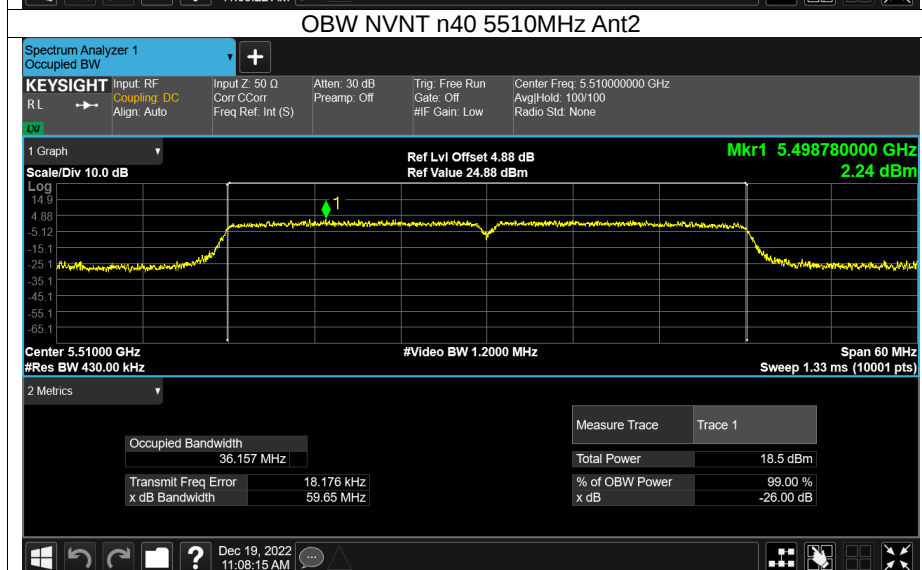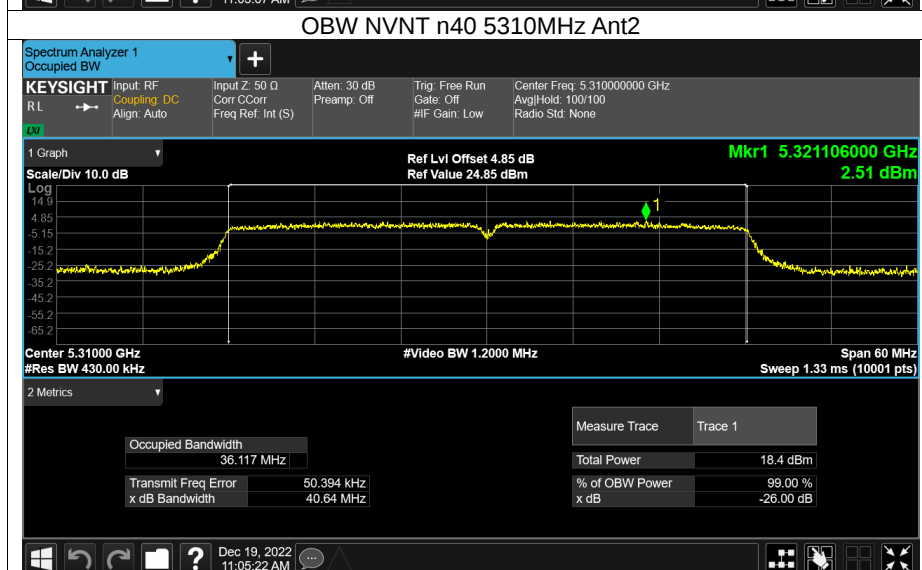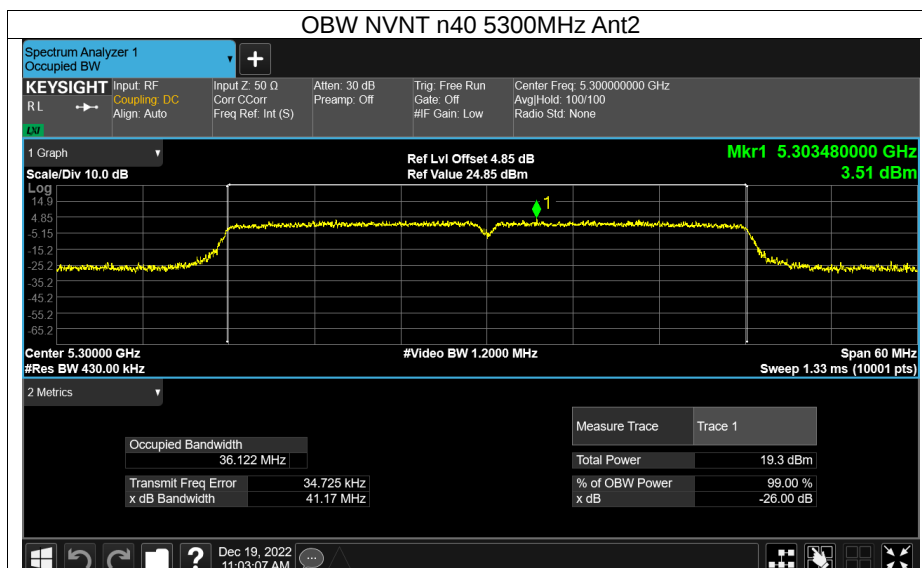


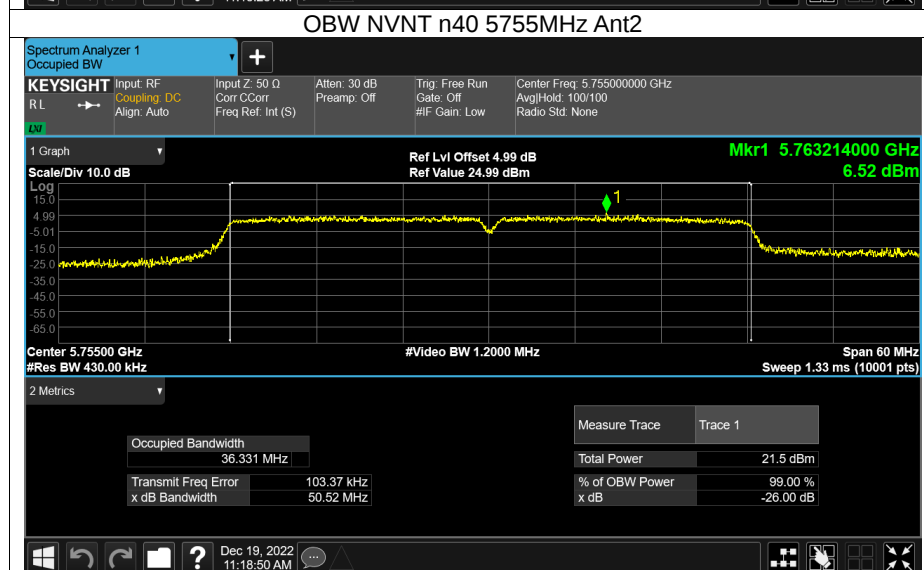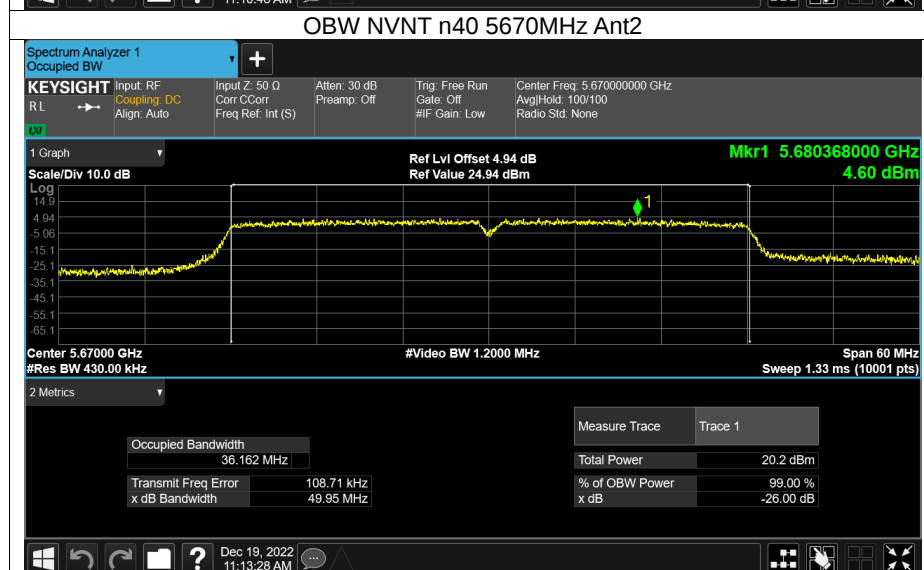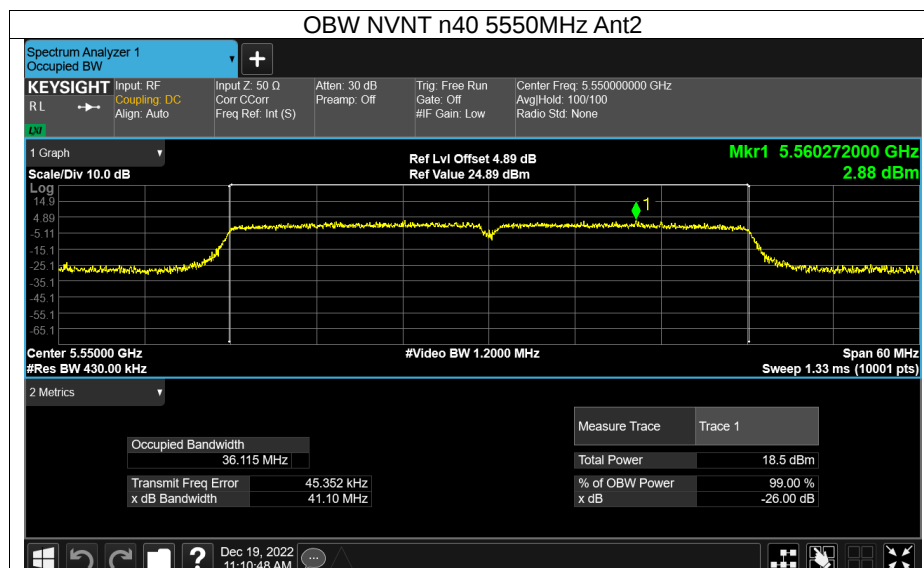




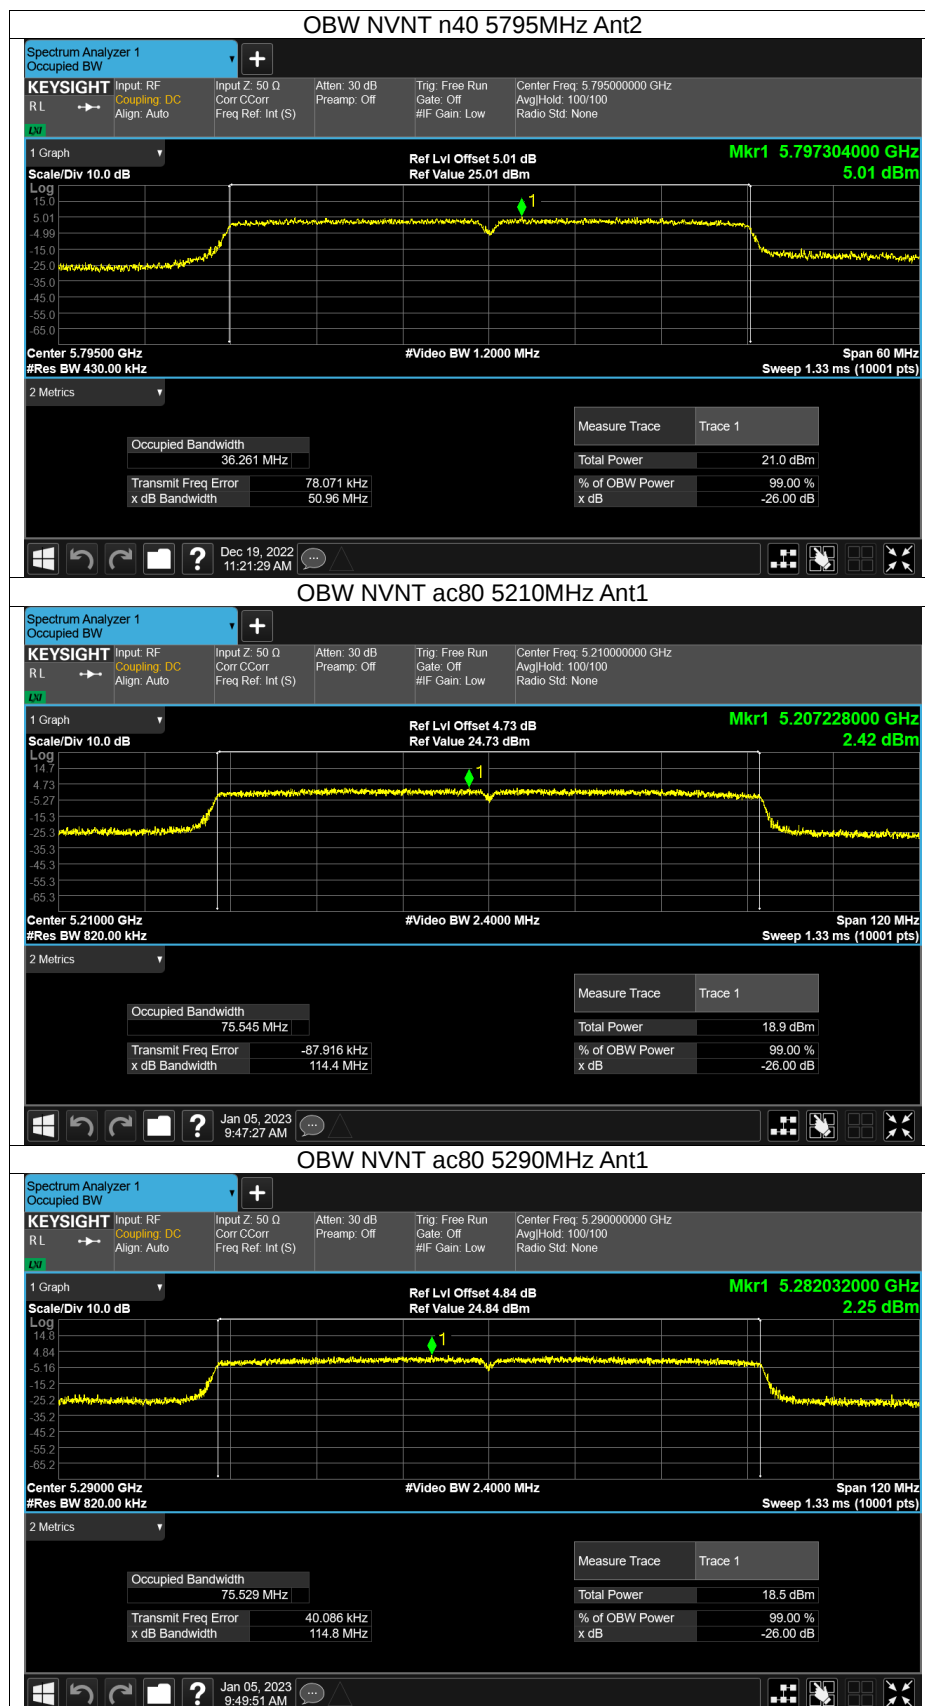


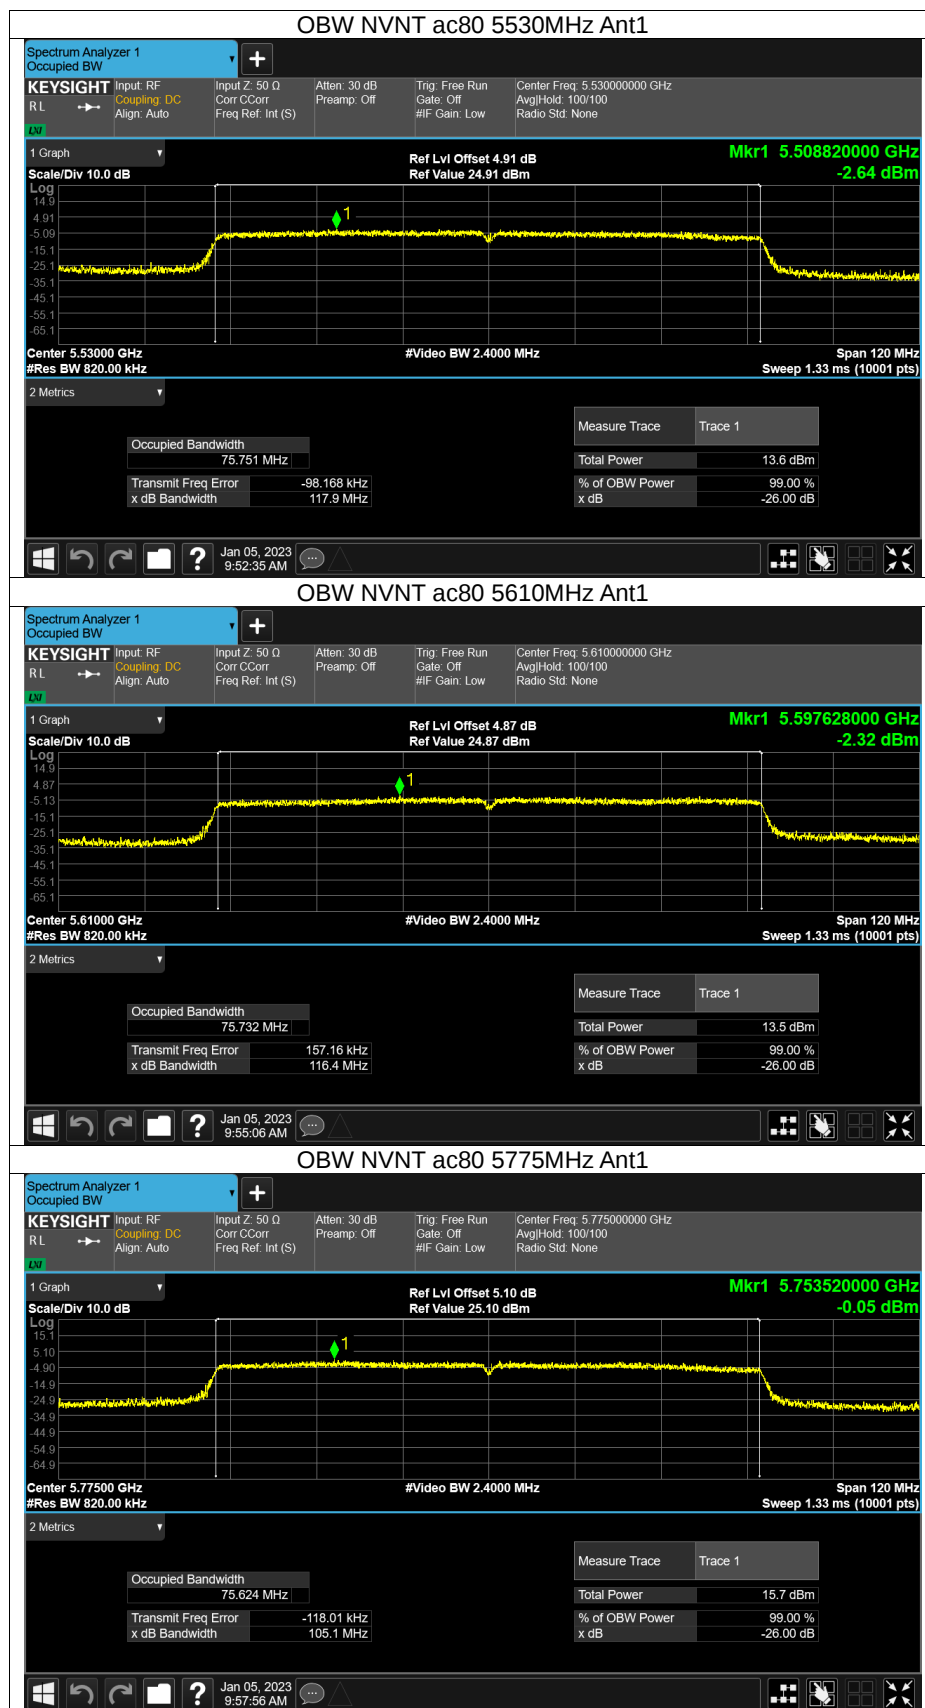


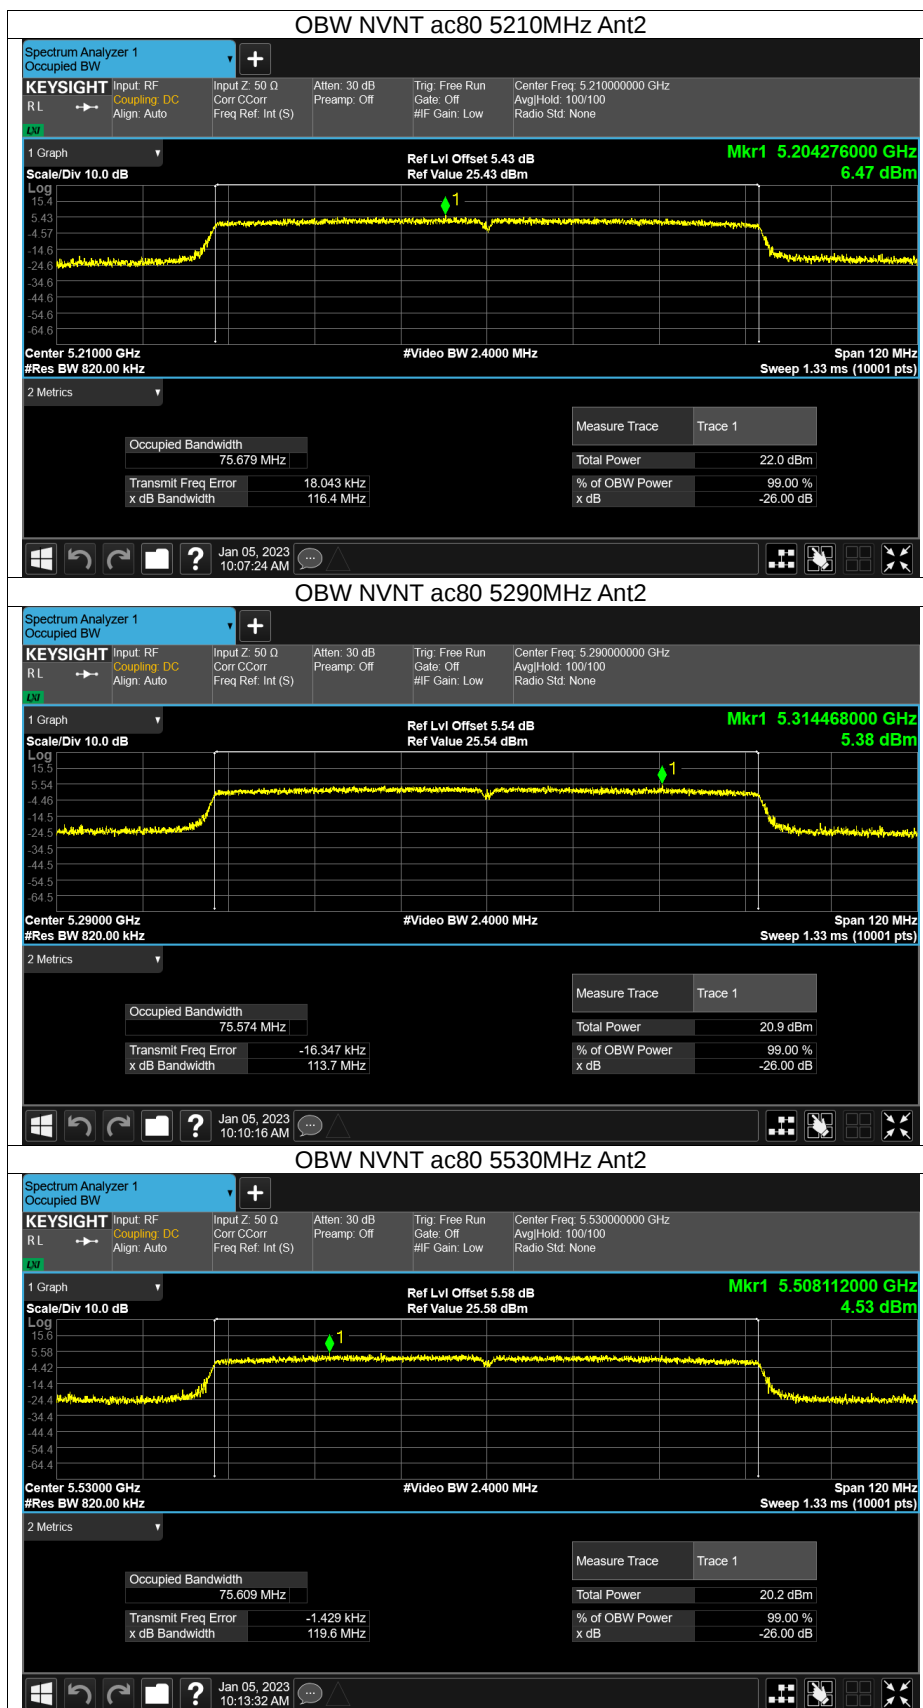

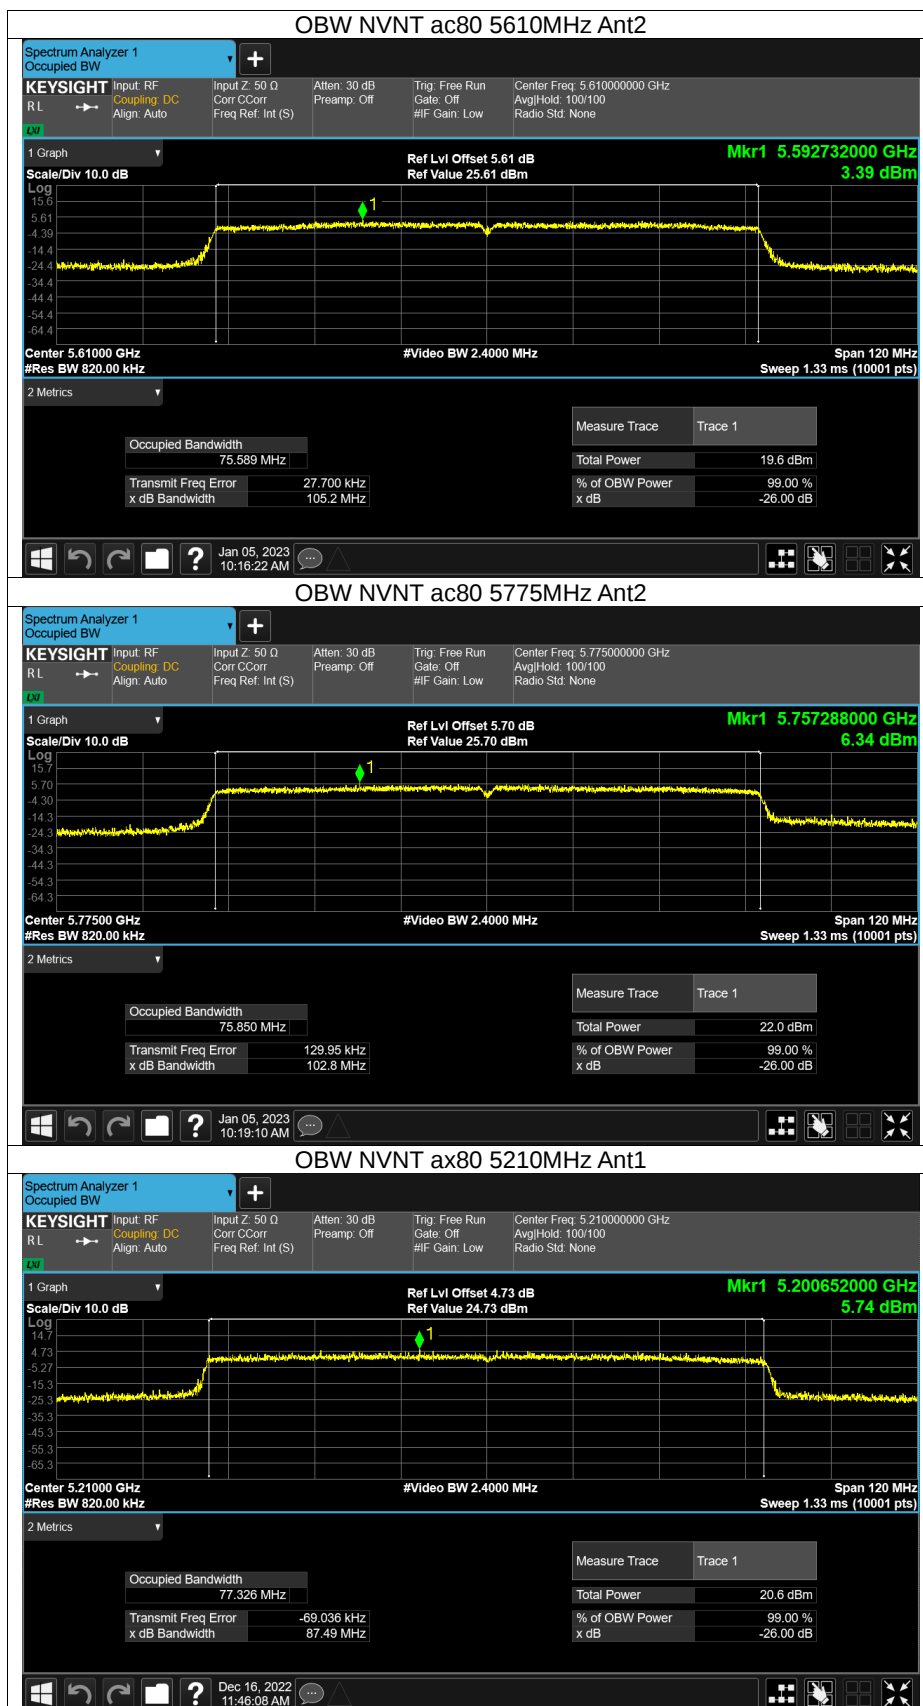

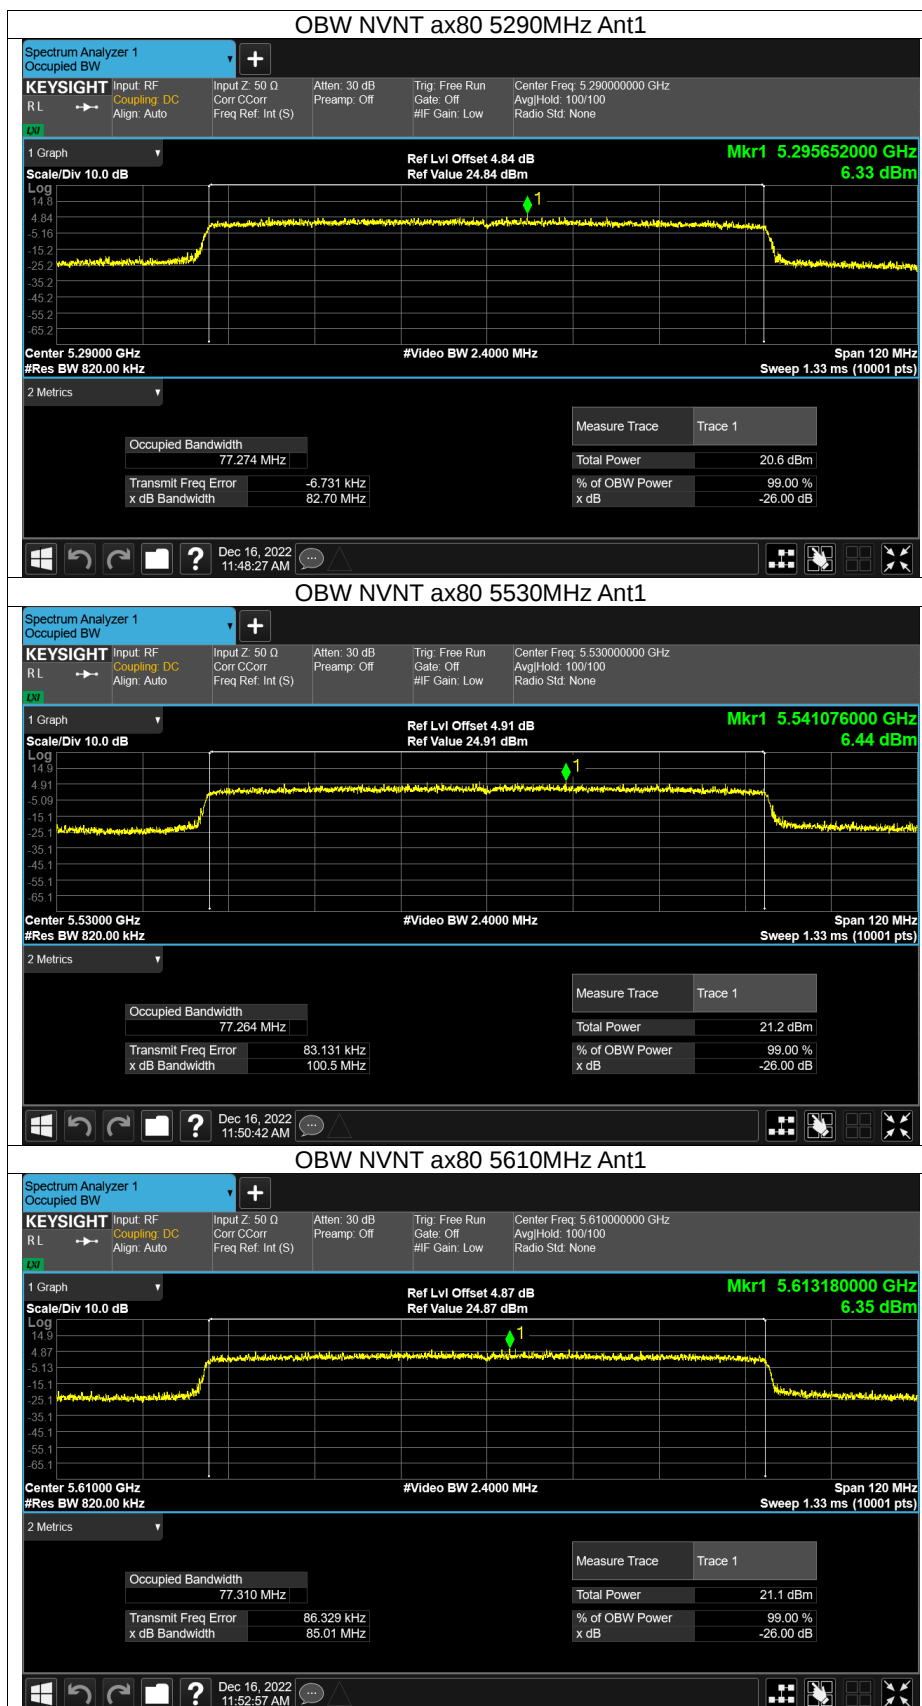

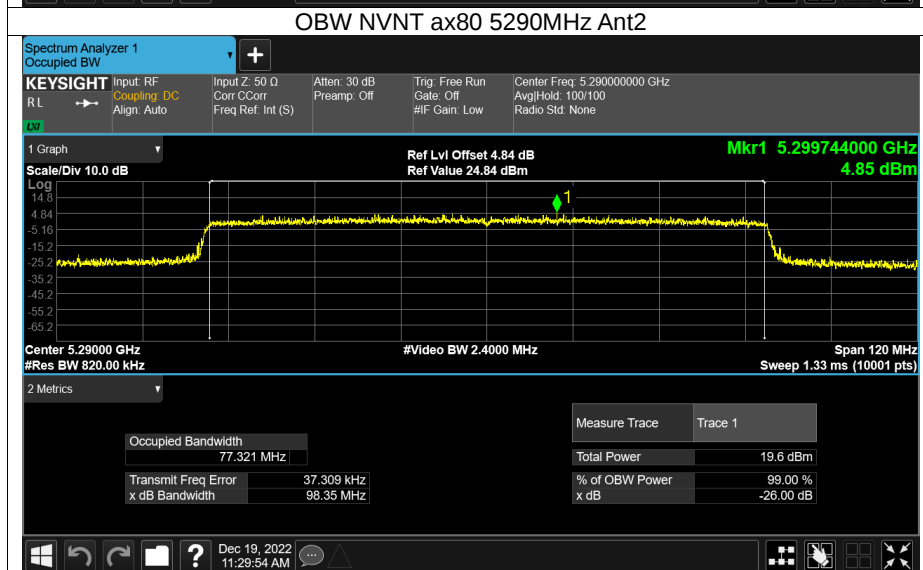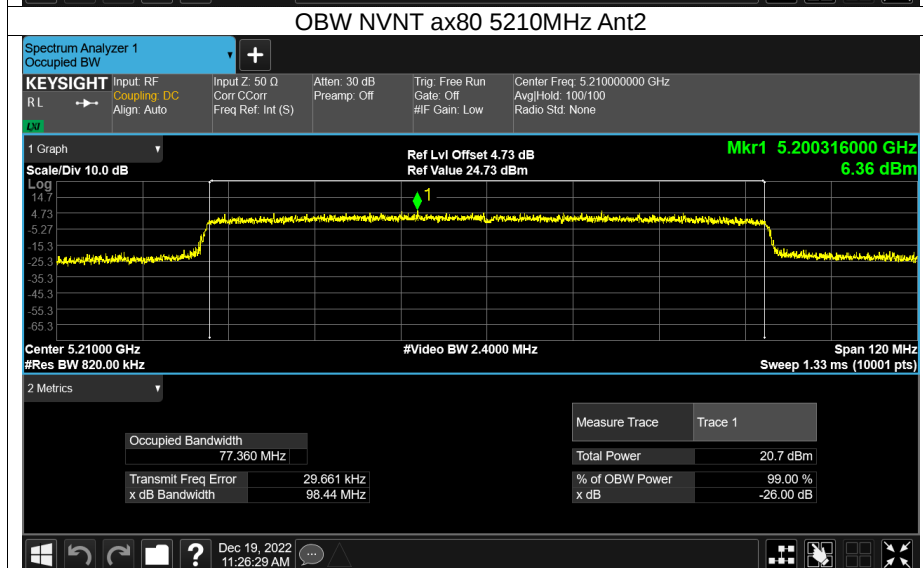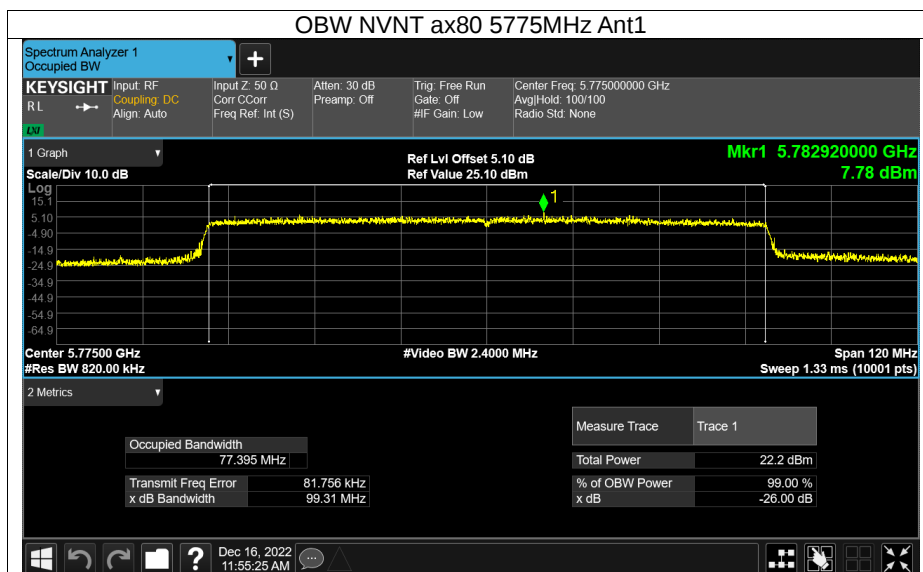

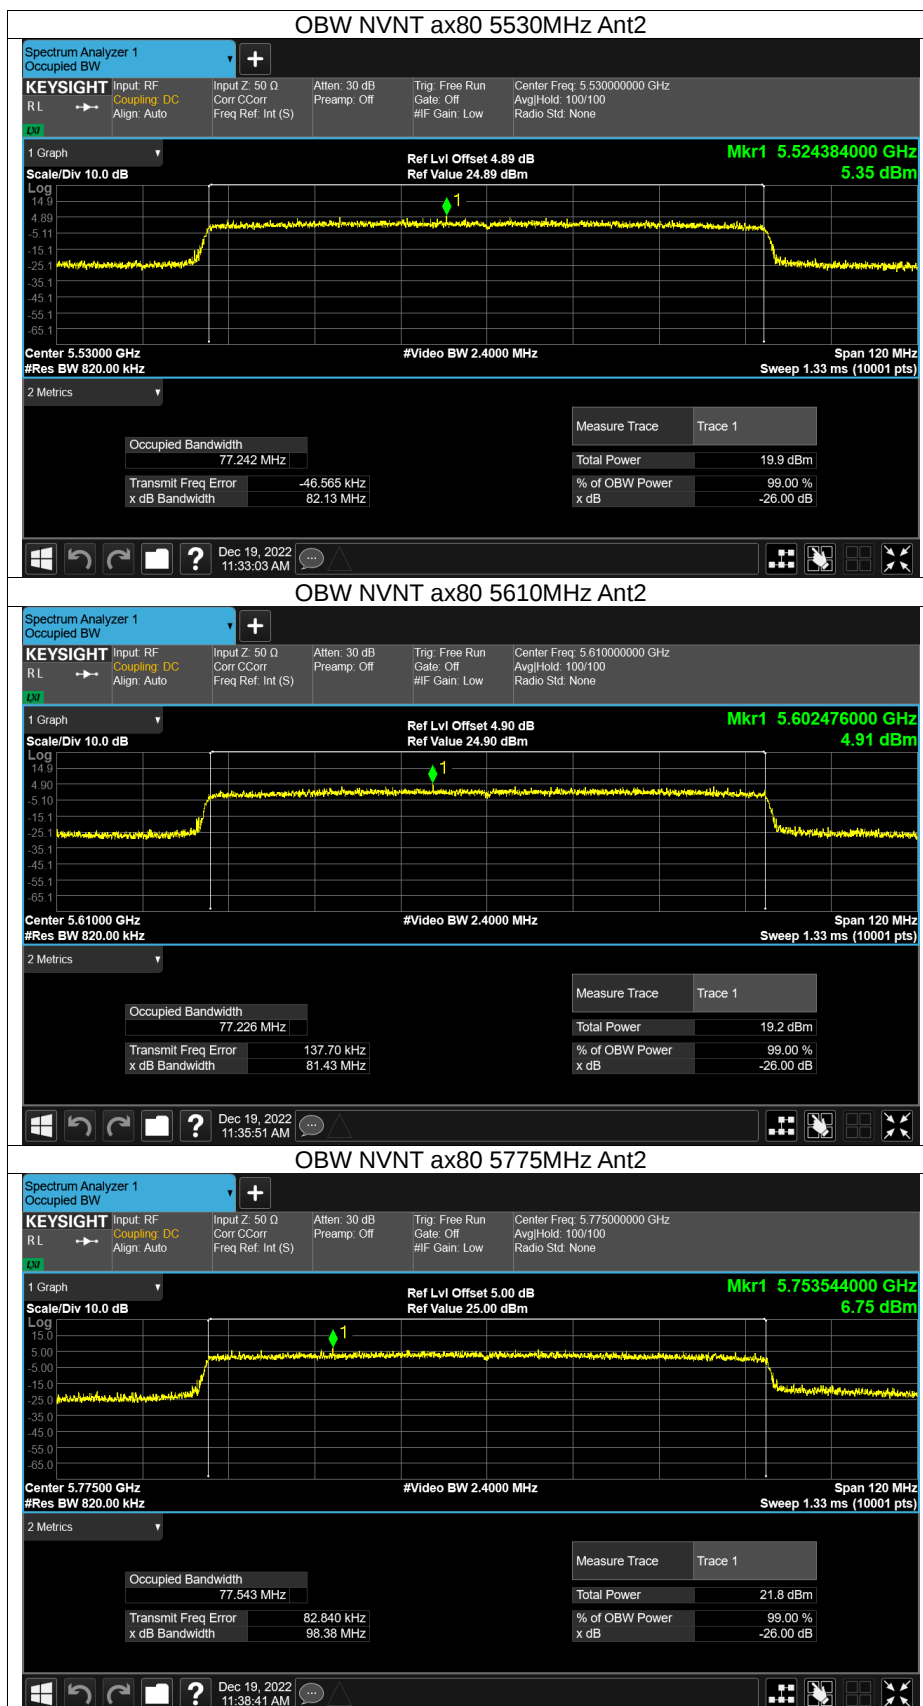



MAXIMUM POWER SPECTRAL DENSITY LEVEL

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	1.45	0	1.45	11	Pass
NVNT	a	5200	Ant1	2	0	2	11	Pass
NVNT	a	5240	Ant1	1.68	0	1.68	11	Pass
NVNT	a	5260	Ant1	1.32	0	1.32	11	Pass
NVNT	a	5300	Ant1	0.46	0	0.46	11	Pass
NVNT	a	5320	Ant1	0.42	0	0.42	11	Pass
NVNT	a	5500	Ant1	3.51	0	3.51	11	Pass
NVNT	a	5580	Ant1	2.94	0	2.94	11	Pass
NVNT	a	5700	Ant1	0.47	0	0.47	11	Pass
NVNT	a	5745	Ant1	-0.8	0	-0.8	30	Pass
NVNT	a	5785	Ant1	0.08	0	0.08	30	Pass
NVNT	a	5825	Ant1	-0.05	0	-0.05	30	Pass
NVNT	a	5180	Ant2	1.2	0	1.2	11	Pass
NVNT	a	5200	Ant2	-0.07	0	-0.07	11	Pass
NVNT	a	5240	Ant2	0.88	0	0.88	11	Pass
NVNT	a	5260	Ant2	0.62	0	0.62	11	Pass
NVNT	a	5300	Ant2	1.2	0	1.2	11	Pass
NVNT	a	5320	Ant2	0.03	0	0.03	11	Pass
NVNT	a	5500	Ant2	1.06	0	1.06	11	Pass
NVNT	a	5580	Ant2	0.65	0	0.65	11	Pass
NVNT	a	5700	Ant2	2.28	0	2.28	11	Pass
NVNT	a	5745	Ant2	-0.33	0	-0.33	30	Pass
NVNT	a	5785	Ant2	-1.99	0	-1.99	30	Pass
NVNT	a	5825	Ant2	-2.84	0	-2.84	30	Pass
NVNT	n20	5180	Ant1	1.66	0	1.66	11	Pass
NVNT	n20	5200	Ant1	1.67	0	1.67	11	Pass
NVNT	n20	5240	Ant1	0.72	0	0.72	11	Pass
NVNT	n20	5260	Ant1	1.06	0	1.06	11	Pass
NVNT	n20	5300	Ant1	0.56	0	0.56	11	Pass
NVNT	n20	5320	Ant1	-0.13	0	-0.13	11	Pass
NVNT	n20	5500	Ant1	1.64	0	1.64	11	Pass
NVNT	n20	5580	Ant1	1.74	0	1.74	11	Pass
NVNT	n20	5700	Ant1	1.56	0	1.56	11	Pass
NVNT	n20	5745	Ant1	-0.69	0	-0.69	30	Pass
NVNT	n20	5785	Ant1	-0.61	0	-0.61	30	Pass
NVNT	n20	5825	Ant1	-0.66	0	-0.66	30	Pass
NVNT	n20	5180	Ant2	0.82	0	0.82	11	Pass
NVNT	n20	5200	Ant2	0.63	0	0.63	11	Pass
NVNT	n20	5240	Ant2	0.46	0	0.46	11	Pass
NVNT	n20	5260	Ant2	-0.32	0	-0.32	11	Pass
NVNT	n20	5300	Ant2	0	0	0	11	Pass
NVNT	n20	5320	Ant2	-0.18	0	-0.18	11	Pass
NVNT	n20	5500	Ant2	0.73	0	0.73	11	Pass
NVNT	n20	5580	Ant2	0.14	0	0.14	11	Pass
NVNT	n20	5700	Ant2	1.59	0	1.59	11	Pass
NVNT	n20	5745	Ant2	-1.58	0	-1.58	30	Pass
NVNT	n20	5785	Ant2	-1.64	0	-1.64	30	Pass
NVNT	n20	5825	Ant2	-1.54	0	-1.54	30	Pass
NVNT	n20	5180	Ant1	-4.65	0	-4.65	11	Pass
NVNT	n20	5180	Ant2	-6.88	0	-6.88	11	Pass
NVNT	n20	5180	Sum	-2.61	0	-2.61	11	Pass
NVNT	n20	5200	Ant1	-1.54	0	-1.54	11	Pass
NVNT	n20	5200	Ant2	-2.93	0	-2.93	11	Pass
NVNT	n20	5200	Sum	0.83	0	0.83	11	Pass
NVNT	n20	5240	Ant1	-1.92	0	-1.92	11	Pass
NVNT	n20	5240	Ant2	-3.68	0	-3.68	11	Pass
NVNT	n20	5240	Sum	0.3	0	0.3	11	Pass
NVNT	n20	5260	Ant1	-2.63	0	-2.63	11	Pass
NVNT	n20	5260	Ant2	-3.67	0	-3.67	11	Pass
NVNT	n20	5260	Sum	-0.11	0	-0.11	11	Pass
NVNT	n20	5300	Ant1	-3.54	0	-3.54	11	Pass
NVNT	n20	5300	Ant2	-3.97	0	-3.97	11	Pass
NVNT	n20	5300	Sum	-0.74	0	-0.74	11	Pass



NVNT	n20	5320	Ant1	-3.97	0	-3.97	11	Pass
NVNT	n20	5320	Ant2	-4.16	0	-4.16	11	Pass
NVNT	n20	5320	Sum	-1.05	0	-1.05	11	Pass
NVNT	n20	5500	Ant1	-1.64	0	-1.64	11	Pass
NVNT	n20	5500	Ant2	-3.13	0	-3.13	11	Pass
NVNT	n20	5500	Sum	0.69	0	0.69	11	Pass
NVNT	n20	5580	Ant1	-1.99	0	-1.99	11	Pass
NVNT	n20	5580	Ant2	-4.85	0	-4.85	11	Pass
NVNT	n20	5580	Sum	-0.18	0	-0.18	11	Pass
NVNT	n20	5700	Ant1	-2.95	0	-2.95	11	Pass
NVNT	n20	5700	Ant2	-1.57	0	-1.57	11	Pass
NVNT	n20	5700	Sum	0.8	0	0.8	11	Pass
NVNT	n20	5745	Ant1	-6.84	0	-6.84	30	Pass
NVNT	n20	5745	Ant2	-4.39	0	-4.39	30	Pass
NVNT	n20	5745	Sum	-2.43	0	-2.43	30	Pass
NVNT	n20	5785	Ant1	-6.21	0	-6.21	30	Pass
NVNT	n20	5785	Ant2	-4.93	0	-4.93	30	Pass
NVNT	n20	5785	Sum	-2.51	0	-2.51	30	Pass
NVNT	n20	5825	Ant1	-5.45	0	-5.45	30	Pass
NVNT	n20	5825	Ant2	-4.6	0	-4.6	30	Pass
NVNT	n20	5825	Sum	-1.99	0	-1.99	30	Pass
NVNT	n40	5190	Ant1	-1.47	0	-1.47	11	Pass
NVNT	n40	5230	Ant1	-1.12	0	-1.12	11	Pass
NVNT	n40	5270	Ant1	-3.84	0	-3.84	11	Pass
NVNT	n40	5310	Ant1	-4.42	0	-4.42	11	Pass
NVNT	n40	5510	Ant1	-0.95	0	-0.95	11	Pass
NVNT	n40	5550	Ant1	-1.9	0	-1.9	11	Pass
NVNT	n40	5670	Ant1	-0.89	0	-0.89	11	Pass
NVNT	n40	5755	Ant1	-2.36	0	-2.36	30	Pass
NVNT	n40	5795	Ant1	-2.39	0	-2.39	30	Pass
NVNT	n40	5190	Ant2	-1.07	0	-1.07	11	Pass
NVNT	n40	5230	Ant2	-1.62	0	-1.62	11	Pass
NVNT	n40	5270	Ant2	-2.25	0	-2.25	11	Pass
NVNT	n40	5300	Ant2	-2.45	0	-2.45	11	Pass
NVNT	n40	5310	Ant2	-3.08	0	-3.08	11	Pass
NVNT	n40	5510	Ant2	-2.87	0	-2.87	11	Pass
NVNT	n40	5550	Ant2	-2.97	0	-2.97	11	Pass
NVNT	n40	5670	Ant2	-0.16	0	-0.16	11	Pass
NVNT	n40	5755	Ant2	-3.02	0	-3.02	30	Pass
NVNT	n40	5795	Ant2	-3.36	0	-3.36	30	Pass
NVNT	n40	5190	Ant1	-4.22	0	-4.22	11	Pass
NVNT	n40	5190	Ant2	-5.23	0	-5.23	11	Pass
NVNT	n40	5190	Sum	-1.69	0	-1.69	11	Pass
NVNT	n40	5230	Ant1	-4.43	0	-4.43	11	Pass
NVNT	n40	5230	Ant2	-5.92	0	-5.92	11	Pass
NVNT	n40	5230	Sum	-2.1	0	-2.1	11	Pass
NVNT	n40	5270	Ant1	-5.15	0	-5.15	11	Pass
NVNT	n40	5270	Ant2	-6.31	0	-6.31	11	Pass
NVNT	n40	5270	Sum	-2.68	0	-2.68	11	Pass
NVNT	n40	5300	Ant1	-5.61	0	-5.61	11	Pass
NVNT	n40	5300	Ant2	-6.94	0	-6.94	11	Pass
NVNT	n40	5300	Sum	-3.21	0	-3.21	11	Pass
NVNT	n40	5310	Ant1	-6.49	0	-6.49	11	Pass
NVNT	n40	5310	Ant2	-6.74	0	-6.74	11	Pass
NVNT	n40	5310	Sum	-3.6	0	-3.6	11	Pass
NVNT	n40	5510	Ant1	-5.08	0	-5.08	11	Pass
NVNT	n40	5510	Ant2	-6.31	0	-6.31	11	Pass
NVNT	n40	5510	Sum	-2.64	0	-2.64	11	Pass
NVNT	n40	5550	Ant1	-5.38	0	-5.38	11	Pass
NVNT	n40	5550	Ant2	-6.8	0	-6.8	11	Pass
NVNT	n40	5550	Sum	-3.02	0	-3.02	11	Pass
NVNT	n40	5670	Ant1	-6.25	0	-6.25	11	Pass
NVNT	n40	5670	Ant2	-4.38	0	-4.38	11	Pass
NVNT	n40	5670	Sum	-2.2	0	-2.2	11	Pass
NVNT	n40	5755	Ant1	-9.35	0	-9.35	30	Pass
NVNT	n40	5755	Ant2	-6.42	0	-6.42	30	Pass
NVNT	n40	5755	Sum	-4.63	0	-4.63	30	Pass
NVNT	n40	5795	Ant1	-8.35	0	-8.35	30	Pass



NVNT	n40	5795	Ant2	-6.24	0	-6.24	30	Pass
NVNT	n40	5795	Sum	-4.16	0	-4.16	30	Pass
NVNT	ac80	5210	Ant1	-4.03	0	-4.03	11	Pass
NVNT	ac80	5290	Ant1	-6.61	0	-6.61	11	Pass
NVNT	ac80	5530	Ant1	-5.31	0	-5.31	11	Pass
NVNT	ac80	5610	Ant1	-6.48	0	-6.48	11	Pass
NVNT	ac80	5775	Ant1	-9.13	0	-9.13	30	Pass
NVNT	ac80	5210	Ant2	-3.22	0	-3.22	11	Pass
NVNT	ac80	5290	Ant2	-4.32	0	-4.32	11	Pass
NVNT	ac80	5530	Ant2	-5.18	0	-5.18	11	Pass
NVNT	ac80	5610	Ant2	-5.56	0	-5.56	11	Pass
NVNT	ac80	5775	Ant2	-6.1	0	-6.1	30	Pass
NVNT	ac80	5210	Ant1	-10.55	0	-10.55	11	Pass
NVNT	ac80	5210	Ant2	-8.97	0	-8.97	11	Pass
NVNT	ac80	5210	Sum	-6.68	0	-6.68	11	Pass
NVNT	ac80	5290	Ant1	-10.82	0	-10.82	11	Pass
NVNT	ac80	5290	Ant2	-8.24	0	-8.24	11	Pass
NVNT	ac80	5290	Sum	-6.33	0	-6.33	11	Pass
NVNT	ac80	5530	Ant1	-11.47	0	-11.47	11	Pass
NVNT	ac80	5530	Ant2	-11.99	0	-11.99	11	Pass
NVNT	ac80	5530	Sum	-8.71	0	-8.71	11	Pass
NVNT	ac80	5610	Ant1	-10.96	0	-10.96	11	Pass
NVNT	ac80	5610	Ant2	-12.38	0	-12.38	11	Pass
NVNT	ac80	5610	Sum	-8.6	0	-8.6	11	Pass
NVNT	ac80	5775	Ant1	-14.26	0	-14.26	30	Pass
NVNT	ac80	5775	Ant2	-12.88	0	-12.88	30	Pass
NVNT	ac80	5775	Sum	-10.51	0	-10.51	30	Pass
NVNT	ax80	5210	Ant1	-4.52	0	-4.52	11	Pass
NVNT	ax80	5290	Ant1	-5.43	0	-5.43	11	Pass
NVNT	ax80	5530	Ant1	-4.84	0	-4.84	11	Pass
NVNT	ax80	5610	Ant1	-4.27	0	-4.27	11	Pass
NVNT	ax80	5775	Ant1	-6.26	0	-6.26	30	Pass
NVNT	ax80	5210	Ant2	-4.89	0	-4.89	11	Pass
NVNT	ax80	5290	Ant2	-6.53	0	-6.53	11	Pass
NVNT	ax80	5530	Ant2	-6.64	0	-6.64	11	Pass
NVNT	ax80	5610	Ant2	-5.8	0	-5.8	11	Pass
NVNT	ax80	5775	Ant2	-7.15	0	-7.15	30	Pass
NVNT	ax80	5210	Ant1	-7.74	0	-7.74	11	Pass
NVNT	ax80	5210	Ant2	-10.76	0	-10.76	11	Pass
NVNT	ax80	5210	Sum	-5.98	0	-5.98	11	Pass
NVNT	ax80	5290	Ant1	-9.24	0	-9.24	11	Pass
NVNT	ax80	5290	Ant2	-9.98	0	-9.98	11	Pass
NVNT	ax80	5290	Sum	-6.58	0	-6.58	11	Pass
NVNT	ax80	5530	Ant1	-8.18	0	-8.18	11	Pass
NVNT	ax80	5530	Ant2	-9.5	0	-9.5	11	Pass
NVNT	ax80	5530	Sum	-5.78	0	-5.78	11	Pass
NVNT	ax80	5610	Ant1	-9.77	0	-9.77	11	Pass
NVNT	ax80	5610	Ant2	-9.55	0	-9.55	11	Pass
NVNT	ax80	5610	Sum	-6.65	0	-6.65	11	Pass
NVNT	ax80	5775	Ant1	-12.88	0	-12.88	30	Pass
NVNT	ax80	5775	Ant2	-10.7	0	-10.7	30	Pass
NVNT	ax80	5775	Sum	-8.64	0	-8.64	30	Pass

