






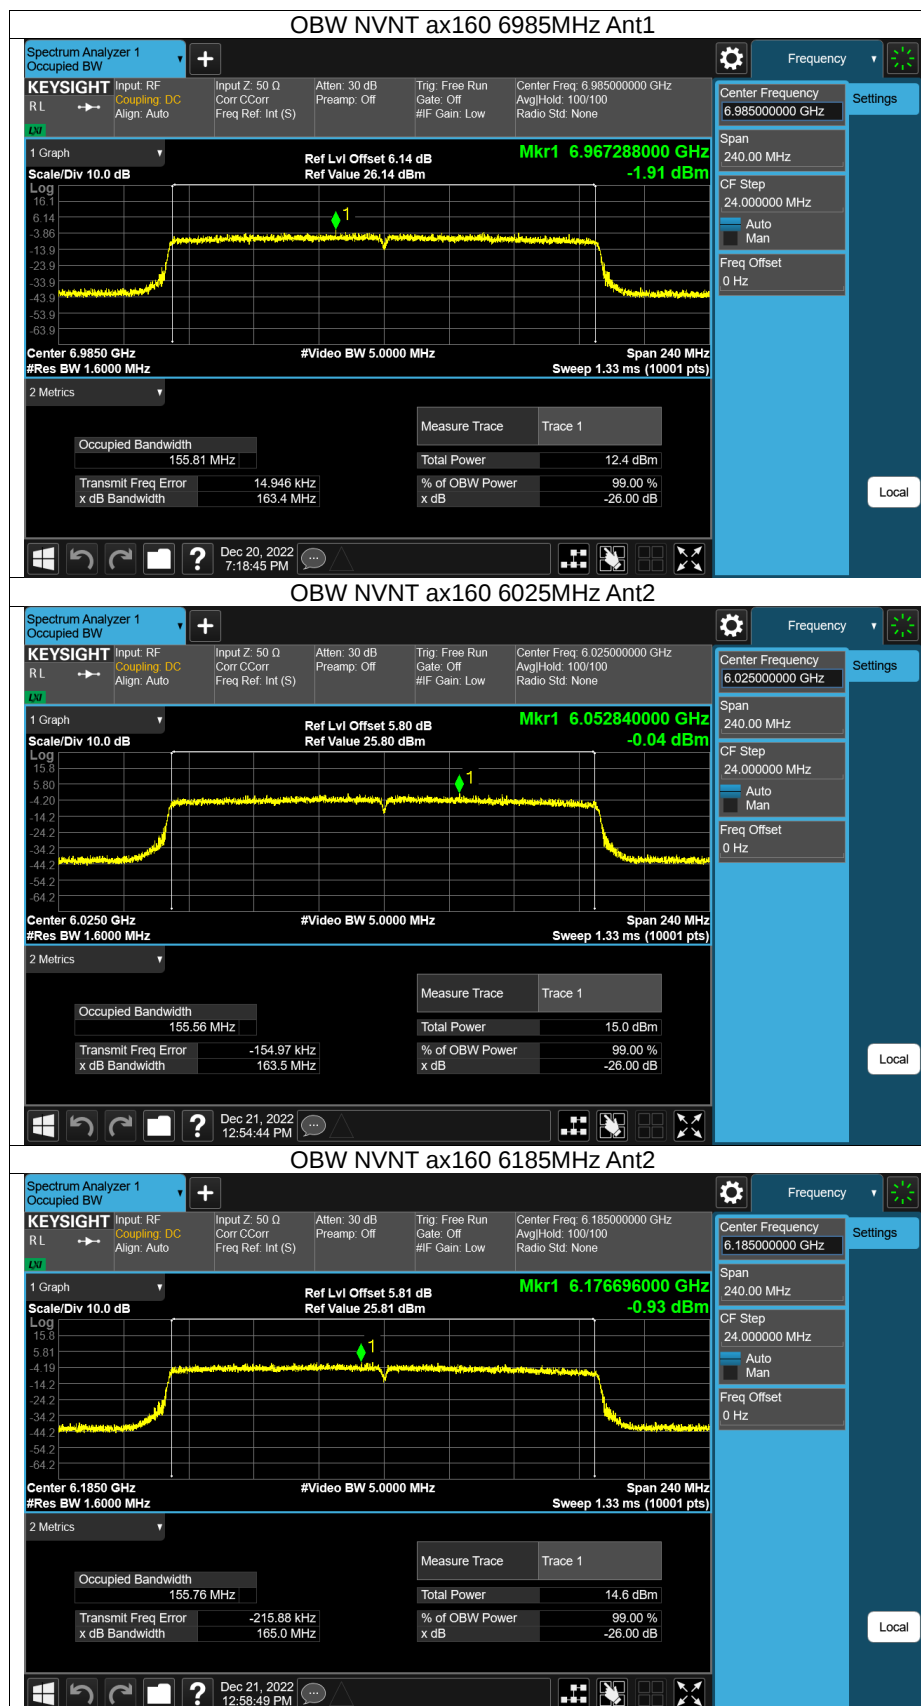

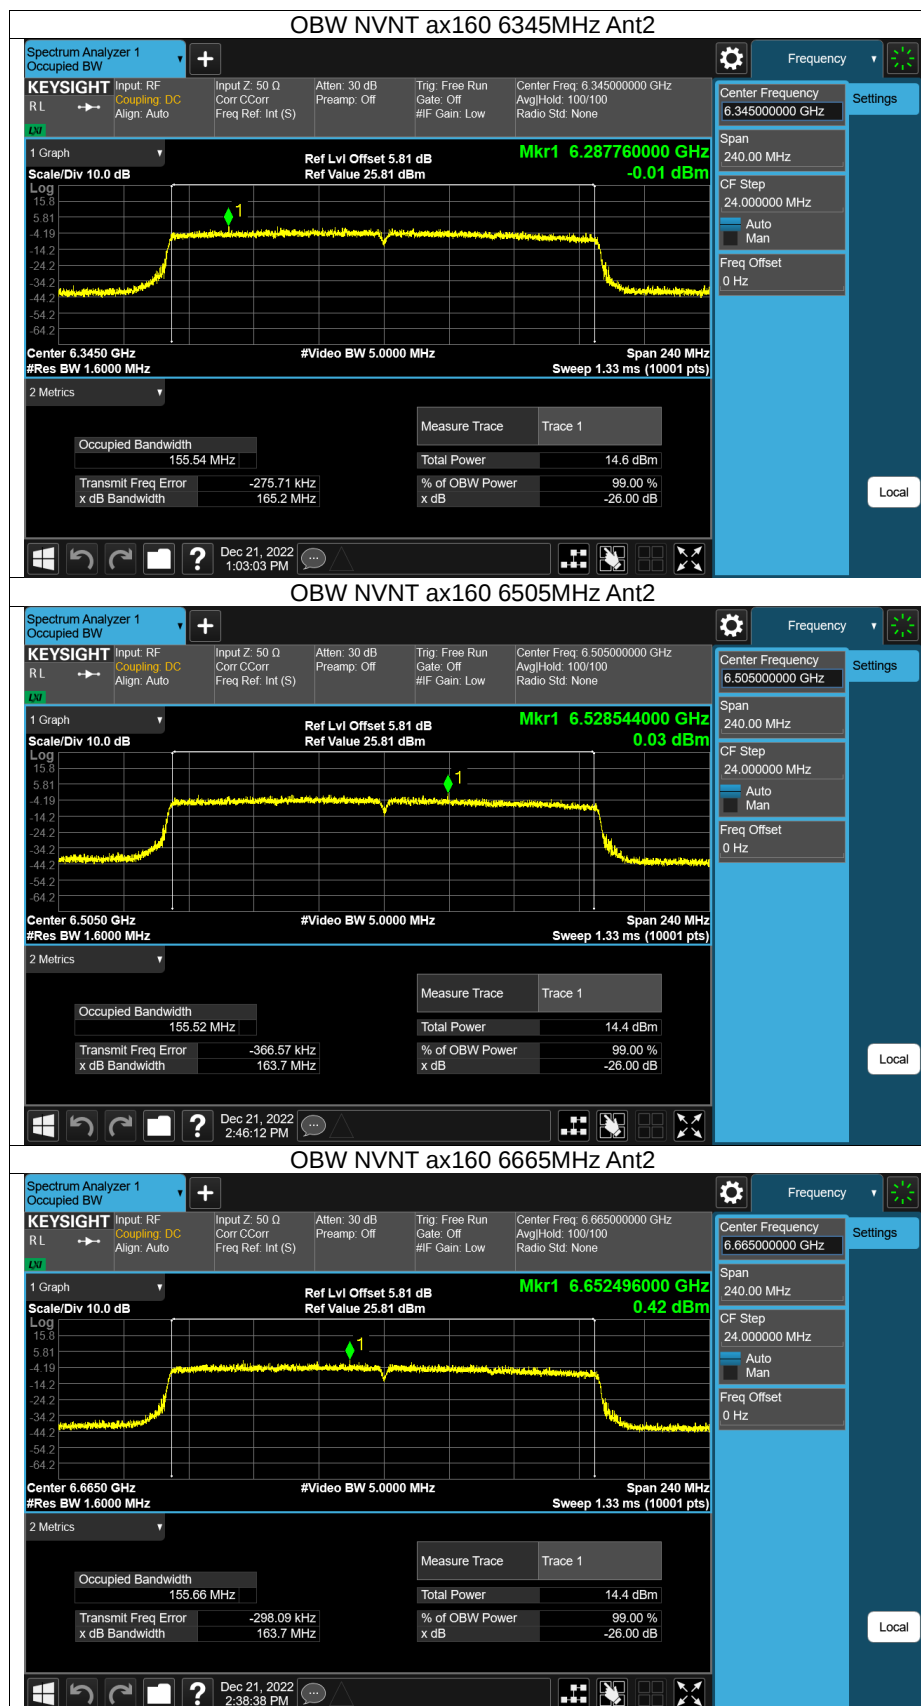

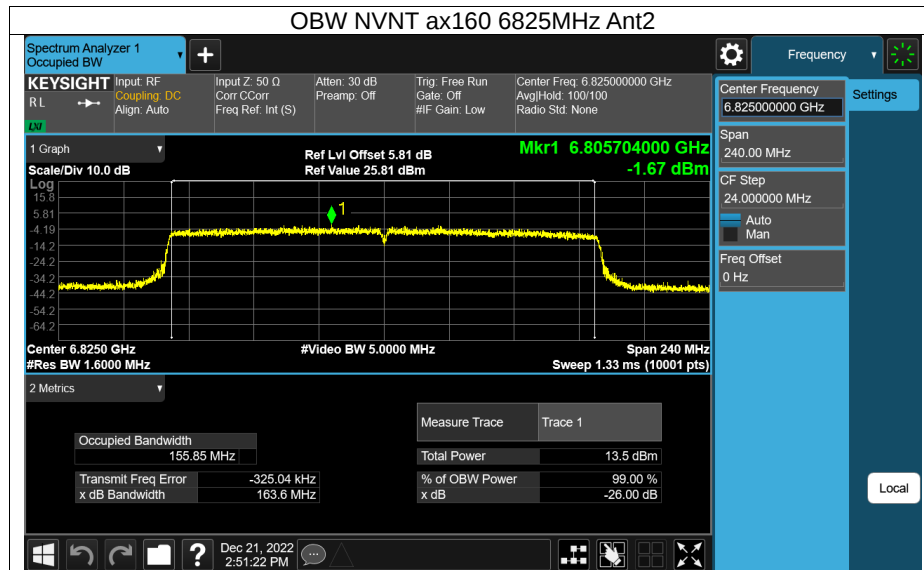

MAXIMUM POWER SPECTRAL DENSITY LEVEL

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Gain (dBi)	eirp (dBm)	Limit (dBm)	Verdict
NVNT	a	5955	Ant1	-5.74	0	-5.74	4.18	-1.56	-1	Pass
NVNT	a	6175	Ant1	-6.68	0	-6.68	4.18	-2.5	-1	Pass
NVNT	a	6415	Ant1	-5.24	0	-5.24	4.18	-1.06	-1	Pass
NVNT	a	6435	Ant1	-5.27	0	-5.27	4.18	-1.09	-1	Pass
NVNT	a	6475	Ant1	-5.25	0	-5.25	4.18	-1.07	-1	Pass
NVNT	a	6515	Ant1	-6.16	0	-6.16	4.18	-1.98	-1	Pass
NVNT	a	6535	Ant1	-6.22	0	-6.22	4.18	-2.04	-1	Pass
NVNT	a	6695	Ant1	-5.58	0	-5.58	4.18	-1.4	-1	Pass
NVNT	a	6855	Ant1	-6.14	0	-6.14	4.18	-1.96	-1	Pass
NVNT	a	6895	Ant1	-6.15	0	-6.15	4.18	-1.97	-1	Pass
NVNT	a	7115	Ant1	-6.74	0	-6.74	4.18	-2.56	-1	Pass
NVNT	a	5955	Ant2	-5.5	0	-5.5	4.18	-1.32	-1	Pass
NVNT	a	6175	Ant2	-5.23	0	-5.23	4.18	-1.05	-1	Pass
NVNT	a	6415	Ant2	-5.96	0	-5.96	4.18	-1.78	-1	Pass
NVNT	a	6435	Ant2	-5.49	0	-5.49	4.18	-1.31	-1	Pass
NVNT	a	6475	Ant2	-5.63	0	-5.63	4.18	-1.45	-1	Pass
NVNT	a	6515	Ant2	-6.57	0	-6.57	4.18	-2.39	-1	Pass
NVNT	a	6535	Ant2	-6.49	0	-6.49	4.18	-2.31	-1	Pass
NVNT	a	6695	Ant2	-5.55	0	-5.55	4.18	-1.37	-1	Pass
NVNT	a	6855	Ant2	-7.07	0	-7.07	4.18	-2.89	-1	Pass
NVNT	a	6895	Ant2	-7.01	0	-7.01	4.18	-2.83	-1	Pass
NVNT	a	7115	Ant2	-6.46	0	-6.46	4.18	-2.28	-1	Pass
NVNT	n20	5955	Ant1	-5.71	0	-5.71	4.18	-1.53	-1	Pass
NVNT	n20	6175	Ant1	-6.8	0	-6.8	4.18	-2.62	-1	Pass
NVNT	n20	6415	Ant1	-6.42	0	-6.42	4.18	-2.24	-1	Pass
NVNT	n20	6435	Ant1	-6	0	-6	4.18	-1.82	-1	Pass
NVNT	n20	6475	Ant1	-6.15	0	-6.15	4.18	-1.97	-1	Pass
NVNT	n20	6515	Ant1	-6.99	0	-6.99	4.18	-2.81	-1	Pass
NVNT	n20	6535	Ant1	-6.96	0	-6.96	4.18	-2.78	-1	Pass
NVNT	n20	6695	Ant1	-5.93	0	-5.93	4.18	-1.75	-1	Pass
NVNT	n20	6855	Ant1	-7.01	0	-7.01	4.18	-2.83	-1	Pass
NVNT	n20	6895	Ant1	-6.9	0	-6.9	4.18	-2.72	-1	Pass
NVNT	n20	7115	Ant1	-7.34	0	-7.34	4.18	-3.16	-1	Pass
NVNT	n20	5955	Ant2	-5.45	0	-5.45	4.18	-1.27	-1	Pass
NVNT	n20	6175	Ant2	-6.35	0	-6.35	4.18	-2.17	-1	Pass
NVNT	n20	6415	Ant2	-6.91	0	-6.91	4.18	-2.73	-1	Pass
NVNT	n20	6435	Ant2	-6.28	0	-6.28	4.18	-2.1	-1	Pass
NVNT	n20	6475	Ant2	-6.08	0	-6.08	4.18	-1.9	-1	Pass
NVNT	n20	6515	Ant2	-7.04	0	-7.04	4.18	-2.86	-1	Pass
NVNT	n20	6535	Ant2	-7.06	0	-7.06	4.18	-2.88	-1	Pass
NVNT	n20	6695	Ant2	-6.17	0	-6.17	4.18	-1.99	-1	Pass
NVNT	n20	6855	Ant2	-7.69	0	-7.69	4.18	-3.51	-1	Pass
NVNT	n20	6895	Ant2	-7.38	0	-7.38	4.18	-3.2	-1	Pass
NVNT	n20	7115	Ant2	-6.86	0	-6.86	4.18	-2.68	-1	Pass
NVNT	n20	5955	Ant1	-8.93	0	-8.93	4.18	-4.75	-1	Pass
NVNT	n20	5955	Ant2	-9.87	0	-9.87	4.18	-5.69	-1	Pass
NVNT	n20	5955	Sum					-2.18	-1	Pass
NVNT	n20	6175	Ant1	-8.83	0	-8.83	4.18	-4.65	-1	Pass
NVNT	n20	6175	Ant2	-9.76	0	-9.76	4.18	-5.58	-1	Pass
NVNT	n20	6175	Sum					-2.08	-1	Pass
NVNT	n20	6415	Ant1	-8.69	0	-8.69	4.18	-4.51	-1	Pass
NVNT	n20	6415	Ant2	-10.24	0	-10.24	4.18	-6.06	-1	Pass
NVNT	n20	6415	Sum					-2.21	-1	Pass
NVNT	n20	6435	Ant1	-8.16	0	-8.16	4.18	-3.98	-1	Pass
NVNT	n20	6435	Ant2	-8.99	0	-8.99	4.18	-4.81	-1	Pass
NVNT	n20	6435	Sum					-1.36	-1	Pass
NVNT	n20	6475	Ant1	-10.29	0	-10.29	4.18	-6.11	-1	Pass
NVNT	n20	6475	Ant2	-11.3	0	-11.3	4.18	-7.12	-1	Pass
NVNT	n20	6475	Sum					-3.58	-1	Pass
NVNT	n20	6515	Ant1	-11.19	0	-11.19	4.18	-7.01	-1	Pass
NVNT	n20	6515	Ant2	-12.49	0	-12.49	4.18	-8.31	-1	Pass
NVNT	n20	6515	Sum					-4.6	-1	Pass
NVNT	n20	6535	Ant1	-11.18	0	-11.18	4.18	-7	-1	Pass



NVNT	n20	6535	Ant2	-11.86	0	-11.86	4.18	-7.68	-1	Pass
NVNT	n20	6535	Sum					-4.32	-1	Pass
NVNT	n20	6695	Ant1	-10.44	0	-10.44	4.18	-6.26	-1	Pass
NVNT	n20	6695	Ant2	-11.04	0	-11.04	4.18	-6.86	-1	Pass
NVNT	n20	6695	Sum					-3.54	-1	Pass
NVNT	n20	6855	Ant1	-12.03	0	-12.03	4.18	-7.85	-1	Pass
NVNT	n20	6855	Ant2	-12.13	0	-12.13	4.18	-7.95	-1	Pass
NVNT	n20	6855	Sum					-4.89	-1	Pass
NVNT	n20	6895	Ant1	-11.41	0	-11.41	4.18	-7.23	-1	Pass
NVNT	n20	6895	Ant2	-12.56	0	-12.56	4.18	-8.38	-1	Pass
NVNT	n20	6895	Sum					-4.76	-1	Pass
NVNT	n20	7115	Ant1	-12.76	0	-12.76	4.18	-8.58	-1	Pass
NVNT	n20	7115	Ant2	-14.64	0	-14.64	4.18	-10.46	-1	Pass
NVNT	n20	7115	Sum					-6.41	-1	Pass
NVNT	n40	5965	Ant1	-7.76	0	-7.76	4.18	-3.58	-1	Pass
NVNT	n40	6165	Ant1	-9.23	0	-9.23	4.18	-5.05	-1	Pass
NVNT	n40	6405	Ant1	-8.94	0	-8.94	4.18	-4.76	-1	Pass
NVNT	n40	6445	Ant1	-8.28	0	-8.28	4.18	-4.1	-1	Pass
NVNT	n40	6485	Ant1	-8.52	0	-8.52	4.18	-4.34	-1	Pass
NVNT	n40	6525	Ant1	-9.51	0	-9.51	4.18	-5.33	-1	Pass
NVNT	n40	6565	Ant1	-9.11	0	-9.11	4.18	-4.93	-1	Pass
NVNT	n40	6685	Ant1	-8.63	0	-8.63	4.18	-4.45	-1	Pass
NVNT	n40	6845	Ant1	-9.74	0	-9.74	4.18	-5.56	-1	Pass
NVNT	n40	6885	Ant1	-9.95	0	-9.95	4.18	-5.77	-1	Pass
NVNT	n40	6925	Ant1	-10.08	0	-10.08	4.18	-5.9	-1	Pass
NVNT	n40	6965	Ant1	-9.91	0	-9.91	4.18	-5.73	-1	Pass
NVNT	n40	7085	Ant1	-10.45	0	-10.45	4.18	-6.27	-1	Pass
NVNT	n40	5965	Ant2	-5.78	0	-5.78	4.18	-1.6	-1	Pass
NVNT	n40	6165	Ant2	-7.13	0	-7.13	4.18	-2.95	-1	Pass
NVNT	n40	6405	Ant2	-7.25	0	-7.25	4.18	-3.07	-1	Pass
NVNT	n40	6445	Ant2	-6.59	0	-6.59	4.18	-2.41	-1	Pass
NVNT	n40	6485	Ant2	-6.32	0	-6.32	4.18	-2.14	-1	Pass
NVNT	n40	6525	Ant2	-7.1	0	-7.1	4.18	-2.92	-1	Pass
NVNT	n40	6565	Ant2	-7.65	0	-7.65	4.18	-3.47	-1	Pass
NVNT	n40	6685	Ant2	-6.55	0	-6.55	4.18	-2.37	-1	Pass
NVNT	n40	6845	Ant2	-8.38	0	-8.38	4.18	-4.2	-1	Pass
NVNT	n40	6885	Ant2	-8.45	0	-8.45	4.18	-4.27	-1	Pass
NVNT	n40	6925	Ant2	-8.22	0	-8.22	4.18	-4.04	-1	Pass
NVNT	n40	6965	Ant2	-7.86	0	-7.86	4.18	-3.68	-1	Pass
NVNT	n40	7085	Ant2	-8.52	0	-8.52	4.18	-4.34	-1	Pass
NVNT	n40	5965	Ant1	-9.33	0	-9.33	4.18	-5.15	-1	Pass
NVNT	n40	5965	Ant2	-10.03	0	-10.03	4.18	-5.85	-1	Pass
NVNT	n40	5965	Sum					-2.48	-1	Pass
NVNT	n40	6165	Ant1	-11.68	0	-11.68	4.18	-7.5	-1	Pass
NVNT	n40	6165	Ant2	-12.44	0	-12.44	4.18	-8.26	-1	Pass
NVNT	n40	6165	Sum					-4.85	-1	Pass
NVNT	n40	6405	Ant1	-11.02	0	-11.02	4.18	-6.84	-1	Pass
NVNT	n40	6405	Ant2	-11.57	0	-11.57	4.18	-7.39	-1	Pass
NVNT	n40	6405	Sum					-4.1	-1	Pass
NVNT	n40	6445	Ant1	-11.15	0	-11.15	4.18	-6.97	-1	Pass
NVNT	n40	6445	Ant2	-12.52	0	-12.52	4.18	-8.34	-1	Pass
NVNT	n40	6445	Sum					-4.59	-1	Pass
NVNT	n40	6485	Ant1	-11.08	0	-11.08	4.18	-6.9	-1	Pass
NVNT	n40	6485	Ant2	-11.95	0	-11.95	4.18	-7.77	-1	Pass
NVNT	n40	6485	Sum					-4.3	-1	Pass
NVNT	n40	6525	Ant1	-11.51	0	-11.51	4.18	-7.33	-1	Pass
NVNT	n40	6525	Ant2	-12.2	0	-12.2	4.18	-8.02	-1	Pass
NVNT	n40	6525	Sum					-4.65	-1	Pass
NVNT	n40	6565	Ant1	-13.74	0	-13.74	4.18	-9.56	-1	Pass
NVNT	n40	6565	Ant2	-13.57	0	-13.57	4.18	-9.39	-1	Pass
NVNT	n40	6565	Sum					-6.46	-1	Pass
NVNT	n40	6685	Ant1	-11.2	0	-11.2	4.18	-7.02	-1	Pass
NVNT	n40	6685	Ant2	-11.5	0	-11.5	4.18	-7.32	-1	Pass
NVNT	n40	6685	Sum					-4.16	-1	Pass
NVNT	n40	6845	Ant1	-13.26	0	-13.26	4.18	-9.08	-1	Pass
NVNT	n40	6845	Ant2	-16.33	0	-16.33	4.18	-12.15	-1	Pass
NVNT	n40	6845	Sum					-7.34	-1	Pass
NVNT	n40	6885	Ant1	-15.16	0	-15.16	4.18	-10.98	-1	Pass



NVNT	n40	6885	Ant2	-16.45	0	-16.45	4.18	-12.27	-1	Pass
NVNT	n40	6885	Sum					-8.57	-1	Pass
NVNT	n40	6925	Ant1	-13.94	0	-13.94	4.18	-9.76	-1	Pass
NVNT	n40	6925	Ant2	-15.05	0	-15.05	4.18	-10.87	-1	Pass
NVNT	n40	6925	Sum					-7.27	-1	Pass
NVNT	n40	6965	Ant1	-13.06	0	-13.06	4.18	-8.88	-1	Pass
NVNT	n40	6965	Ant2	-14.31	0	-14.31	4.18	-10.13	-1	Pass
NVNT	n40	6965	Sum					-6.45	-1	Pass
NVNT	n40	7085	Ant1	-13.29	0	-13.29	4.18	-9.11	-1	Pass
NVNT	n40	7085	Ant2	-16.49	0	-16.49	4.18	-12.31	-1	Pass
NVNT	n40	7085	Sum					-7.41	-1	Pass
NVNT	ac80	5985	Ant1	-10.6	0	-10.6	4.18	-6.42	-1	Pass
NVNT	ac80	6145	Ant1	-13.29	0	-13.29	4.18	-9.11	-1	Pass
NVNT	ac80	6385	Ant1	-12.34	0	-12.34	4.18	-8.16	-1	Pass
NVNT	ac80	6465	Ant1	-11.76	0	-11.76	4.18	-7.58	-1	Pass
NVNT	ac80	6545	Ant1	-12.64	0	-12.64	4.18	-8.46	-1	Pass
NVNT	ac80	6625	Ant1	-12.11	0	-12.11	4.18	-7.93	-1	Pass
NVNT	ac80	6705	Ant1	-12.09	0	-12.09	4.18	-7.91	-1	Pass
NVNT	ac80	6785	Ant1	-12.72	0	-12.72	4.18	-8.54	-1	Pass
NVNT	ac80	6865	Ant1	-12.62	0	-12.62	4.18	-8.44	-1	Pass
NVNT	ac80	6945	Ant1	-13.18	0	-13.18	4.18	-9	-1	Pass
NVNT	ac80	7025	Ant1	-14.53	0	-14.53	4.18	-10.35	-1	Pass
NVNT	ac80	5985	Ant2	-9.17	0	-9.17	4.18	-4.99	-1	Pass
NVNT	ac80	6145	Ant2	-14.07	0	-14.07	4.18	-9.89	-1	Pass
NVNT	ac80	6465	Ant2	-9.72	0	-9.72	4.18	-5.54	-1	Pass
NVNT	ac80	6545	Ant2	-10.66	0	-10.66	4.18	-6.48	-1	Pass
NVNT	ac80	6625	Ant2	-10.41	0	-10.41	4.18	-6.23	-1	Pass
NVNT	ac80	6705	Ant2	-10.02	0	-10.02	4.18	-5.84	-1	Pass
NVNT	ac80	6785	Ant2	-11.06	0	-11.06	4.18	-6.88	-1	Pass
NVNT	ac80	6865	Ant2	-11.49	0	-11.49	4.18	-7.31	-1	Pass
NVNT	ac80	6945	Ant2	-11.56	0	-11.56	4.18	-7.38	-1	Pass
NVNT	ac80	7025	Ant2	-12.38	0	-12.38	4.18	-8.2	-1	Pass
NVNT	ac80	5985	Ant1	-8.83	0	-8.83	4.18	-4.65	-1	Pass
NVNT	ac80	5985	Ant2	-9.32	0	-9.32	4.18	-5.14	-1	Pass
NVNT	ac80	5985	Sum					-1.88	-1	Pass
NVNT	ac80	6145	Ant1	-11.09	0	-11.09	4.18	-6.91	-1	Pass
NVNT	ac80	6145	Ant2	-11.74	0	-11.74	4.18	-7.56	-1	Pass
NVNT	ac80	6145	Sum					-4.21	-1	Pass
NVNT	ac80	6385	Ant1	-12.18	0	-12.18	4.18	-8	-1	Pass
NVNT	ac80	6385	Ant2	-13.25	0	-13.25	4.18	-9.07	-1	Pass
NVNT	ac80	6385	Sum					-5.49	-1	Pass
NVNT	ac80	6465	Ant1	-9.94	0	-9.94	4.18	-5.76	-1	Pass
NVNT	ac80	6465	Ant2	-14.04	0	-14.04	4.18	-9.86	-1	Pass
NVNT	ac80	6465	Sum					-4.33	-1	Pass
NVNT	ac80	6545	Ant1	-13.69	0	-13.69	4.18	-9.51	-1	Pass
NVNT	ac80	6545	Ant2	-13.56	0	-13.56	4.18	-9.38	-1	Pass
NVNT	ac80	6545	Sum					-6.43	-1	Pass
NVNT	ac80	6625	Ant1	-10.41	0	-10.41	4.18	-6.23	-1	Pass
NVNT	ac80	6625	Ant2	-14.03	0	-14.03	4.18	-9.85	-1	Pass
NVNT	ac80	6625	Sum					-4.66	-1	Pass
NVNT	ac80	6705	Ant1	-11.23	0	-11.23	4.18	-7.05	-1	Pass
NVNT	ac80	6705	Ant2	-12.56	0	-12.56	4.18	-8.38	-1	Pass
NVNT	ac80	6705	Sum					-4.65	-1	Pass
NVNT	ac80	6785	Ant1	-11.04	0	-11.04	4.18	-6.86	-1	Pass
NVNT	ac80	6785	Ant2	-14.07	0	-14.07	4.18	-9.89	-1	Pass
NVNT	ac80	6785	Sum					-5.11	-1	Pass
NVNT	ac80	6865	Ant1	-12.21	0	-12.21	4.18	-8.03	-1	Pass
NVNT	ac80	6865	Ant2	-14.27	0	-14.27	4.18	-10.09	-1	Pass
NVNT	ac80	6865	Sum					-5.93	-1	Pass
NVNT	ac80	6945	Ant1	-11.48	0	-11.48	4.18	-7.3	-1	Pass
NVNT	ac80	6945	Ant2	-14.75	0	-14.75	4.18	-10.57	-1	Pass
NVNT	ac80	6945	Sum					-5.62	-1	Pass
NVNT	ac80	7025	Ant1	-14.49	0	-14.49	4.18	-10.31	-1	Pass
NVNT	ac80	7025	Ant2	-13.81	0	-13.81	4.18	-9.63	-1	Pass
NVNT	ac80	7025	Sum					-6.95	-1	Pass
NVNT	ax80	5985	Ant1	-11.09	0	-11.09	4.18	-6.91	-1	Pass
NVNT	ax80	6145	Ant1	-12.98	0	-12.98	4.18	-8.8	-1	Pass
NVNT	ax80	6385	Ant1	-11.91	0	-11.91	4.18	-7.73	-1	Pass



NVNT	ax80	6465	Ant1	-11.96	0	-11.96	4.18	-7.78	-1	Pass
NVNT	ax80	6545	Ant1	-12.88	0	-12.88	4.18	-8.7	-1	Pass
NVNT	ax80	6625	Ant1	-12.11	0	-12.11	4.18	-7.93	-1	Pass
NVNT	ax80	6705	Ant1	-12.2	0	-12.2	4.18	-8.02	-1	Pass
NVNT	ax80	6785	Ant1	-12.85	0	-12.85	4.18	-8.67	-1	Pass
NVNT	ax80	6865	Ant1	-12.58	0	-12.58	4.18	-8.4	-1	Pass
NVNT	ax80	6945	Ant1	-13.46	0	-13.46	4.18	-9.28	-1	Pass
NVNT	ax80	7025	Ant1	-14.6	0	-14.6	4.18	-10.42	-1	Pass
NVNT	ax80	5985	Ant2	-9.04	0	-9.04	4.18	-4.86	-1	Pass
NVNT	ax80	6145	Ant2	-10.17	0	-10.17	4.18	-5.99	-1	Pass
NVNT	ax80	6385	Ant2	-10.33	0	-10.33	4.18	-6.15	-1	Pass
NVNT	ax80	6465	Ant2	-9.88	0	-9.88	4.18	-5.7	-1	Pass
NVNT	ax80	6545	Ant2	-10.44	0	-10.44	4.18	-6.26	-1	Pass
NVNT	ax80	6625	Ant2	-10.56	0	-10.56	4.18	-6.38	-1	Pass
NVNT	ax80	6705	Ant2	-10.02	0	-10.02	4.18	-5.84	-1	Pass
NVNT	ax80	6785	Ant2	-11.15	0	-11.15	4.18	-6.97	-1	Pass
NVNT	ax80	6865	Ant2	-11.44	0	-11.44	4.18	-7.26	-1	Pass
NVNT	ax80	6945	Ant2	-11.54	0	-11.54	4.18	-7.36	-1	Pass
NVNT	ax80	7025	Ant2	-12.32	0	-12.32	4.18	-8.14	-1	Pass
NVNT	ax80	5985	Ant1	-8.59	0	-8.59	4.18	-4.41	-1	Pass
NVNT	ax80	5985	Ant2	-9.87	0	-9.87	4.18	-5.69	-1	Pass
NVNT	ax80	5985	Sum					-1.99	-1	Pass
NVNT	ax80	6145	Ant1	-11.75	0	-11.75	4.18	-7.57	-1	Pass
NVNT	ax80	6145	Ant2	-11.61	0	-11.61	4.18	-7.43	-1	Pass
NVNT	ax80	6145	Sum					-4.49	-1	Pass
NVNT	ax80	6385	Ant1	-11.1	0	-11.1	4.18	-6.92	-1	Pass
NVNT	ax80	6385	Ant2	-13.76	0	-13.76	4.18	-9.58	-1	Pass
NVNT	ax80	6385	Sum					-5.04	-1	Pass
NVNT	ax80	6465	Ant1	-9.87	0	-9.87	4.18	-5.69	-1	Pass
NVNT	ax80	6465	Ant2	-11.71	0	-11.71	4.18	-7.53	-1	Pass
NVNT	ax80	6465	Sum					-3.5	-1	Pass
NVNT	ax80	6545	Ant1	-12.84	0	-12.84	4.18	-8.66	-1	Pass
NVNT	ax80	6545	Ant2	-13.28	0	-13.28	4.18	-9.1	-1	Pass
NVNT	ax80	6545	Sum					-5.86	-1	Pass
NVNT	ax80	6625	Ant1	-9.86	0	-9.86	4.18	-5.68	-1	Pass
NVNT	ax80	6625	Ant2	-13.07	0	-13.07	4.18	-8.89	-1	Pass
NVNT	ax80	6625	Sum					-3.98	-1	Pass
NVNT	ax80	6705	Ant1	-10.86	0	-10.86	4.18	-6.68	-1	Pass
NVNT	ax80	6705	Ant2	-12.46	0	-12.46	4.18	-8.28	-1	Pass
NVNT	ax80	6705	Sum					-4.4	-1	Pass
NVNT	ax80	6785	Ant1	-10.72	0	-10.72	4.18	-6.54	-1	Pass
NVNT	ax80	6785	Ant2	-13.56	0	-13.56	4.18	-9.38	-1	Pass
NVNT	ax80	6785	Sum					-4.72	-1	Pass
NVNT	ax80	6865	Ant1	-12.74	0	-12.74	4.18	-8.56	-1	Pass
NVNT	ax80	6865	Ant2	-12.54	0	-12.54	4.18	-8.36	-1	Pass
NVNT	ax80	6865	Sum					-5.45	-1	Pass
NVNT	ax80	6945	Ant1	-10.9	0	-10.9	4.18	-6.72	-1	Pass
NVNT	ax80	6945	Ant2	-13.74	0	-13.74	4.18	-9.56	-1	Pass
NVNT	ax80	6945	Sum					-4.9	-1	Pass
NVNT	ax80	7025	Ant1	-12.87	0	-12.87	4.18	-8.69	-1	Pass
NVNT	ax80	7025	Ant2	-13.97	0	-13.97	4.18	-9.79	-1	Pass
NVNT	ax80	7025	Sum					-6.19	-1	Pass
NVNT	ax160	6025	Ant1	-14.27	0	-14.27	4.18	-10.09	-1	Pass
NVNT	ax160	6185	Ant1	-14.66	0	-14.66	4.18	-10.48	-1	Pass
NVNT	ax160	6345	Ant1	-14.34	0	-14.34	4.18	-10.16	-1	Pass
NVNT	ax160	6505	Ant1	-14.43	0	-14.43	4.18	-10.25	-1	Pass
NVNT	ax160	6665	Ant1	-14.37	0	-14.37	4.18	-10.19	-1	Pass
NVNT	ax160	6825	Ant1	-15.43	0	-15.43	4.18	-11.25	-1	Pass
NVNT	ax160	6985	Ant1	-16.57	0	-16.57	4.18	-12.39	-1	Pass
NVNT	ax160	6025	Ant2	-11.81	0	-11.81	4.18	-7.63	-1	Pass
NVNT	ax160	6185	Ant2	-11.91	0	-11.91	4.18	-7.73	-1	Pass
NVNT	ax160	6345	Ant2	-12.17	0	-12.17	4.18	-7.99	-1	Pass
NVNT	ax160	6505	Ant2	-12.68	0	-12.68	4.18	-8.5	-1	Pass
NVNT	ax160	6665	Ant2	-12.66	0	-12.66	4.18	-8.48	-1	Pass
NVNT	ax160	6825	Ant2	-13.76	0	-13.76	4.18	-9.58	-1	Pass
NVNT	ax160	6985	Ant2	-14.41	0	-14.41	4.18	-10.23	-1	Pass
NVNT	ax160	6025	Ant1	-11.89	0	-11.89	4.18	-7.71	-1	Pass
NVNT	ax160	6025	Ant2	-11.95	0	-11.95	4.18	-7.77	-1	Pass



NVNT	ax160	6025	Sum					-4.73	-1	Pass
NVNT	ax160	6185	Ant1	-12.1	0	-12.1	4.18	-7.92	-1	Pass
NVNT	ax160	6185	Ant2	-13.51	0	-13.51	4.18	-9.33	-1	Pass
NVNT	ax160	6185	Sum					-5.56	-1	Pass
NVNT	ax160	6345	Ant1	-12.52	0	-12.52	4.18	-8.34	-1	Pass
NVNT	ax160	6345	Ant2	-15.61	0	-15.61	4.18	-11.43	-1	Pass
NVNT	ax160	6345	Sum					-6.61	-1	Pass
NVNT	ax160	6505	Ant1	-12.5	0	-12.5	4.18	-8.32	-1	Pass
NVNT	ax160	6505	Ant2	-15.02	0	-15.02	4.18	-10.84	-1	Pass
NVNT	ax160	6505	Sum					-6.39	-1	Pass
NVNT	ax160	6665	Ant1	-14.59	0	-14.59	4.18	-10.41	-1	Pass
NVNT	ax160	6665	Ant2	-16.17	0	-16.17	4.18	-11.99	-1	Pass
NVNT	ax160	6665	Sum					-8.12	-1	Pass
NVNT	ax160	6825	Ant1	-13.18	0	-13.18	4.18	-9	-1	Pass
NVNT	ax160	6825	Ant2	-15.72	0	-15.72	4.18	-11.54	-1	Pass
NVNT	ax160	6825	Sum					-7.08	-1	Pass
NVNT	ax160	6985	Ant1	-15.08	0	-15.08	4.18	-10.9	-1	Pass
NVNT	ax160	6985	Ant2	-16.64	0	-16.64	4.18	-12.46	-1	Pass
NVNT	ax160	6985	Sum					-8.6	-1	Pass

