




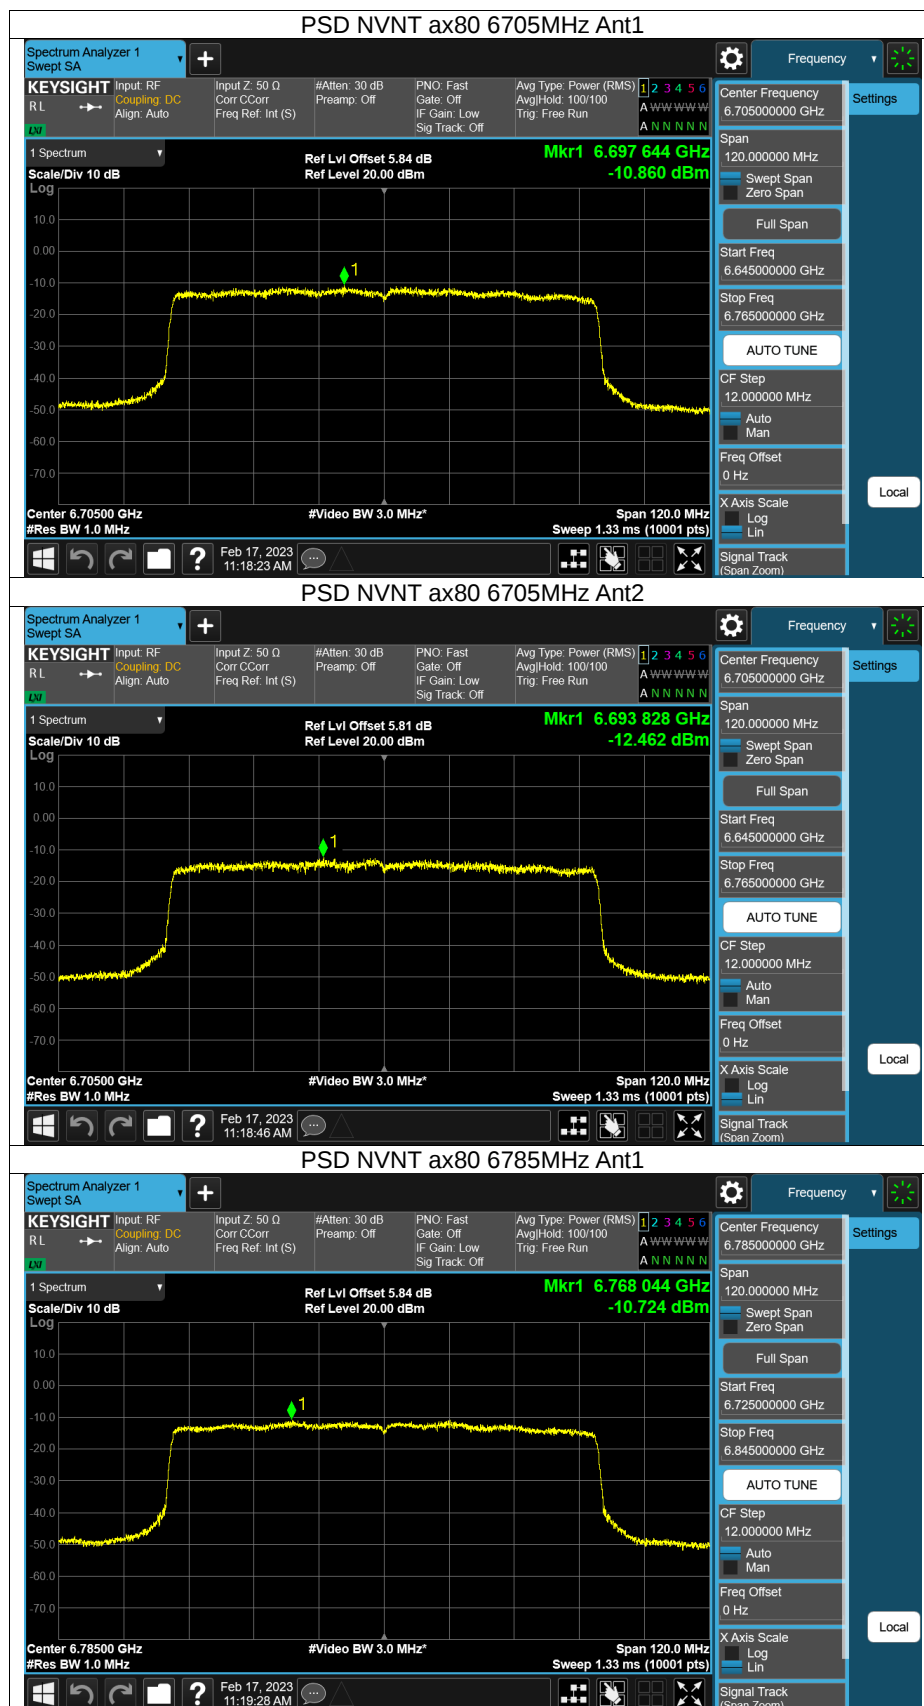
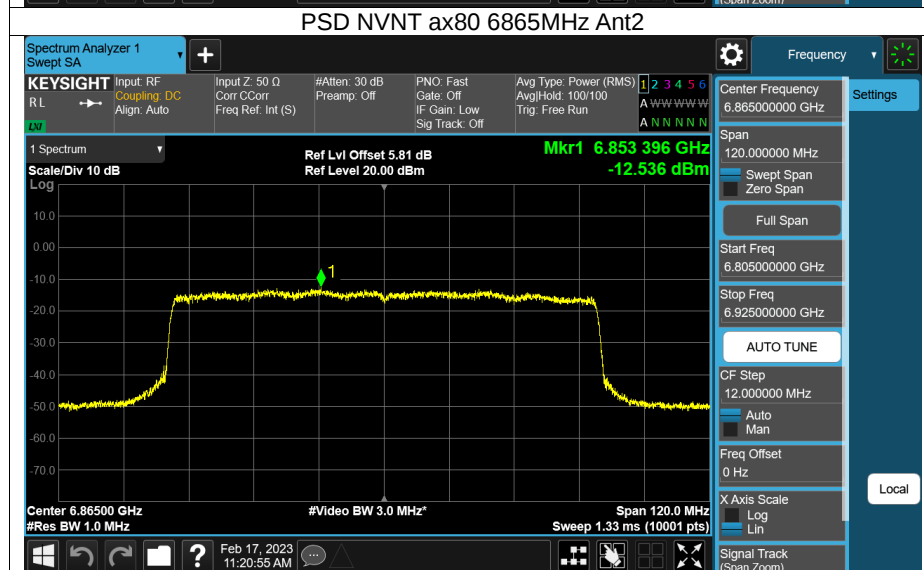
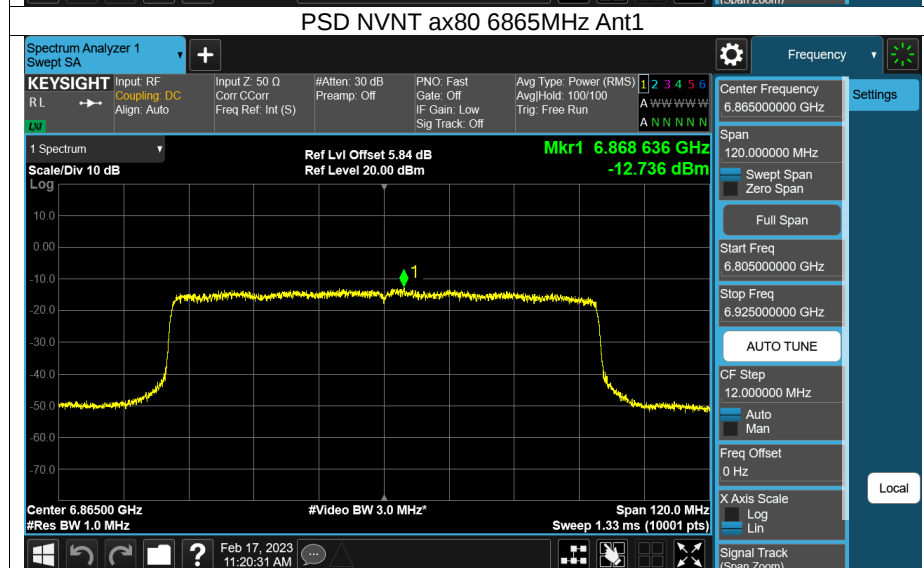
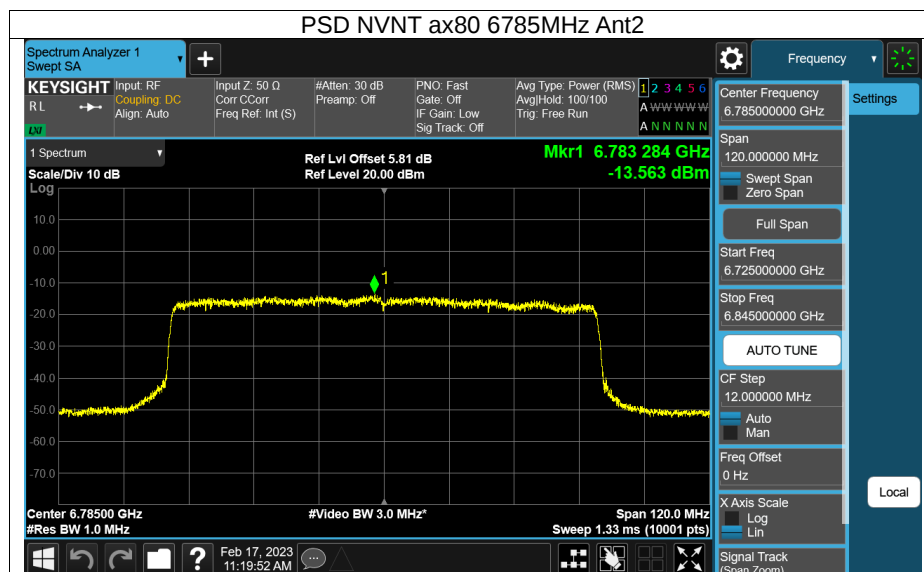


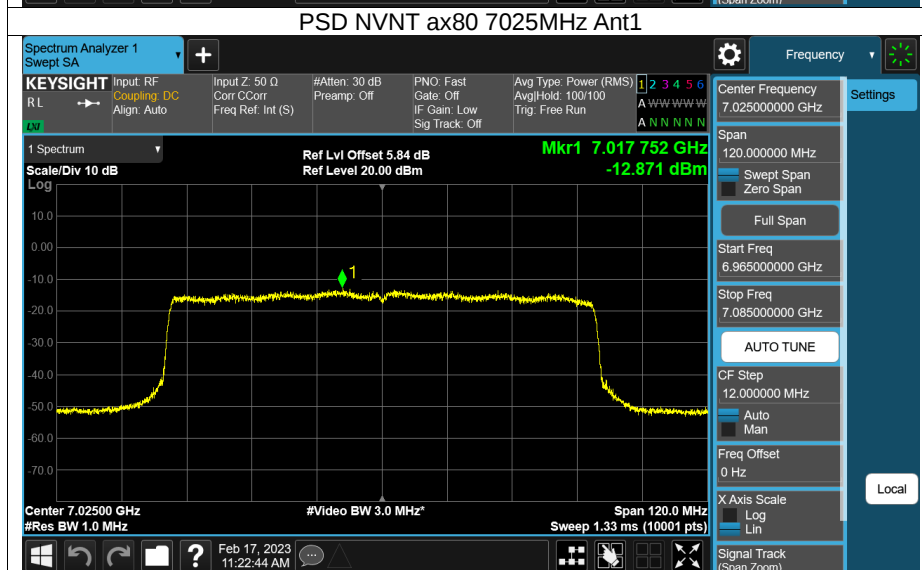

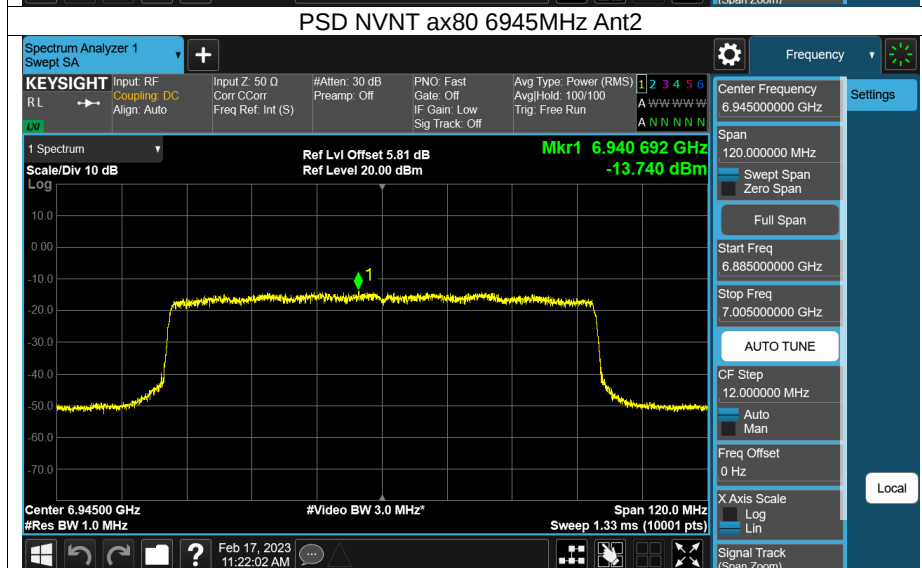


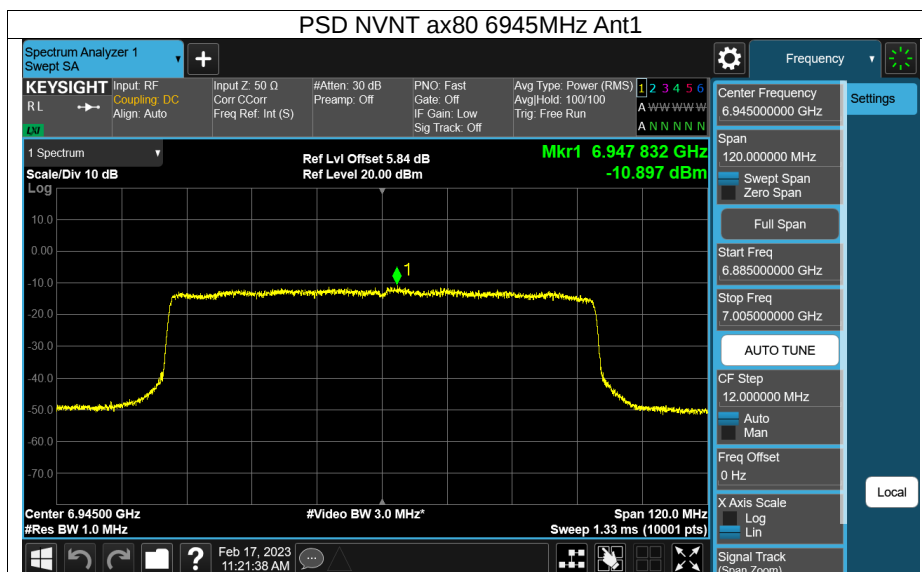


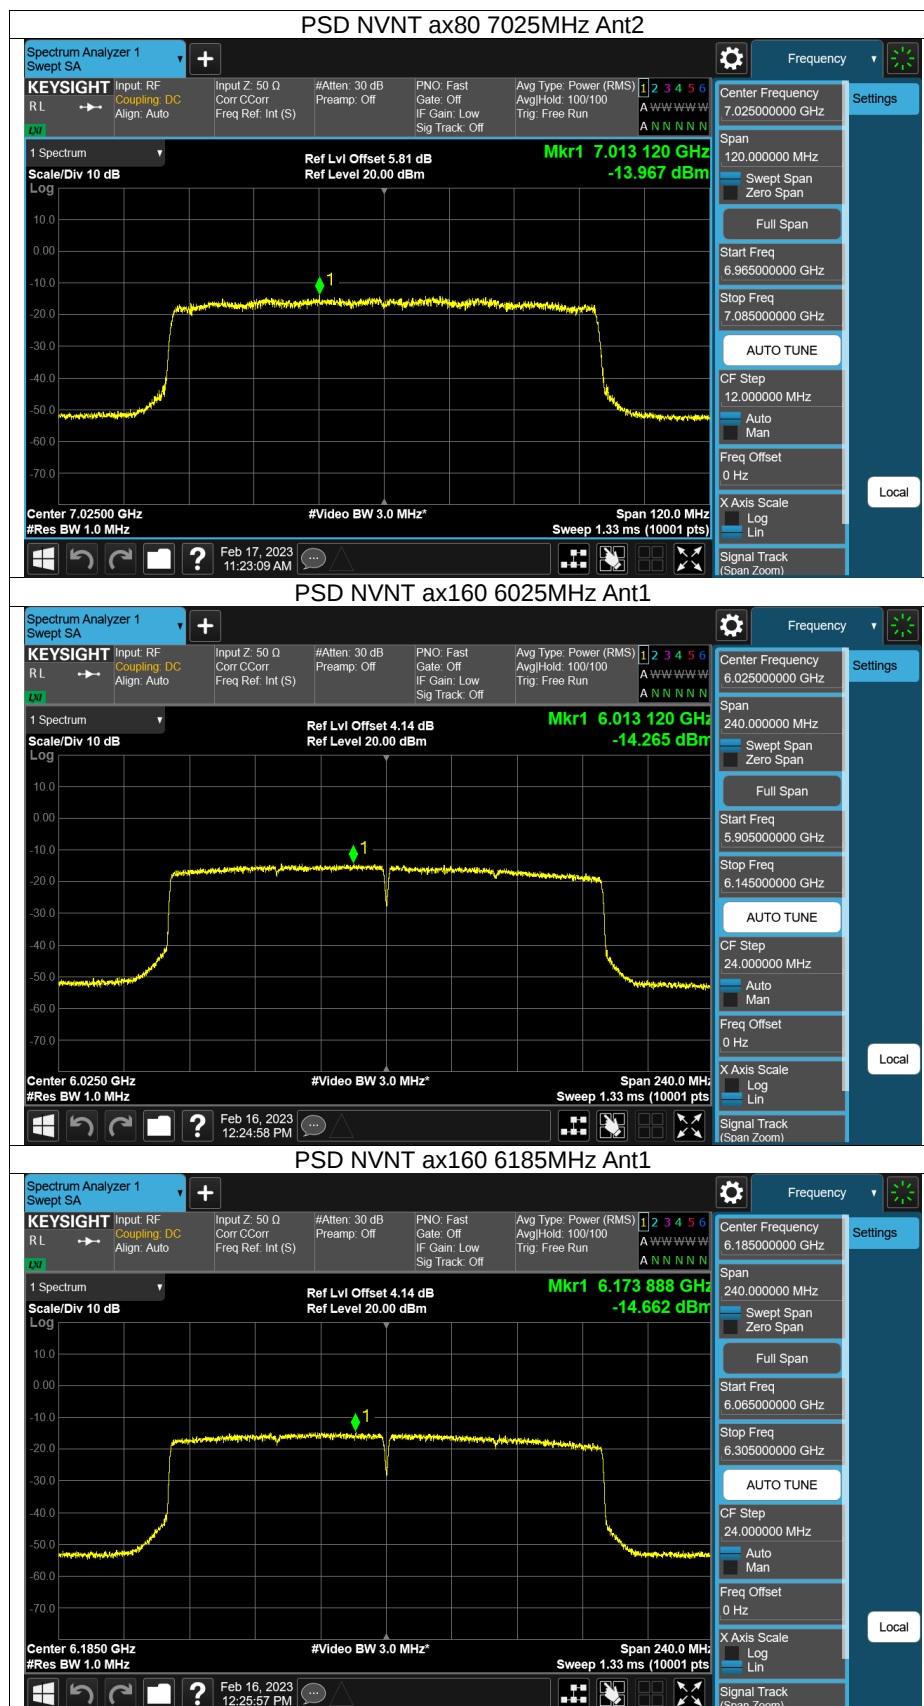


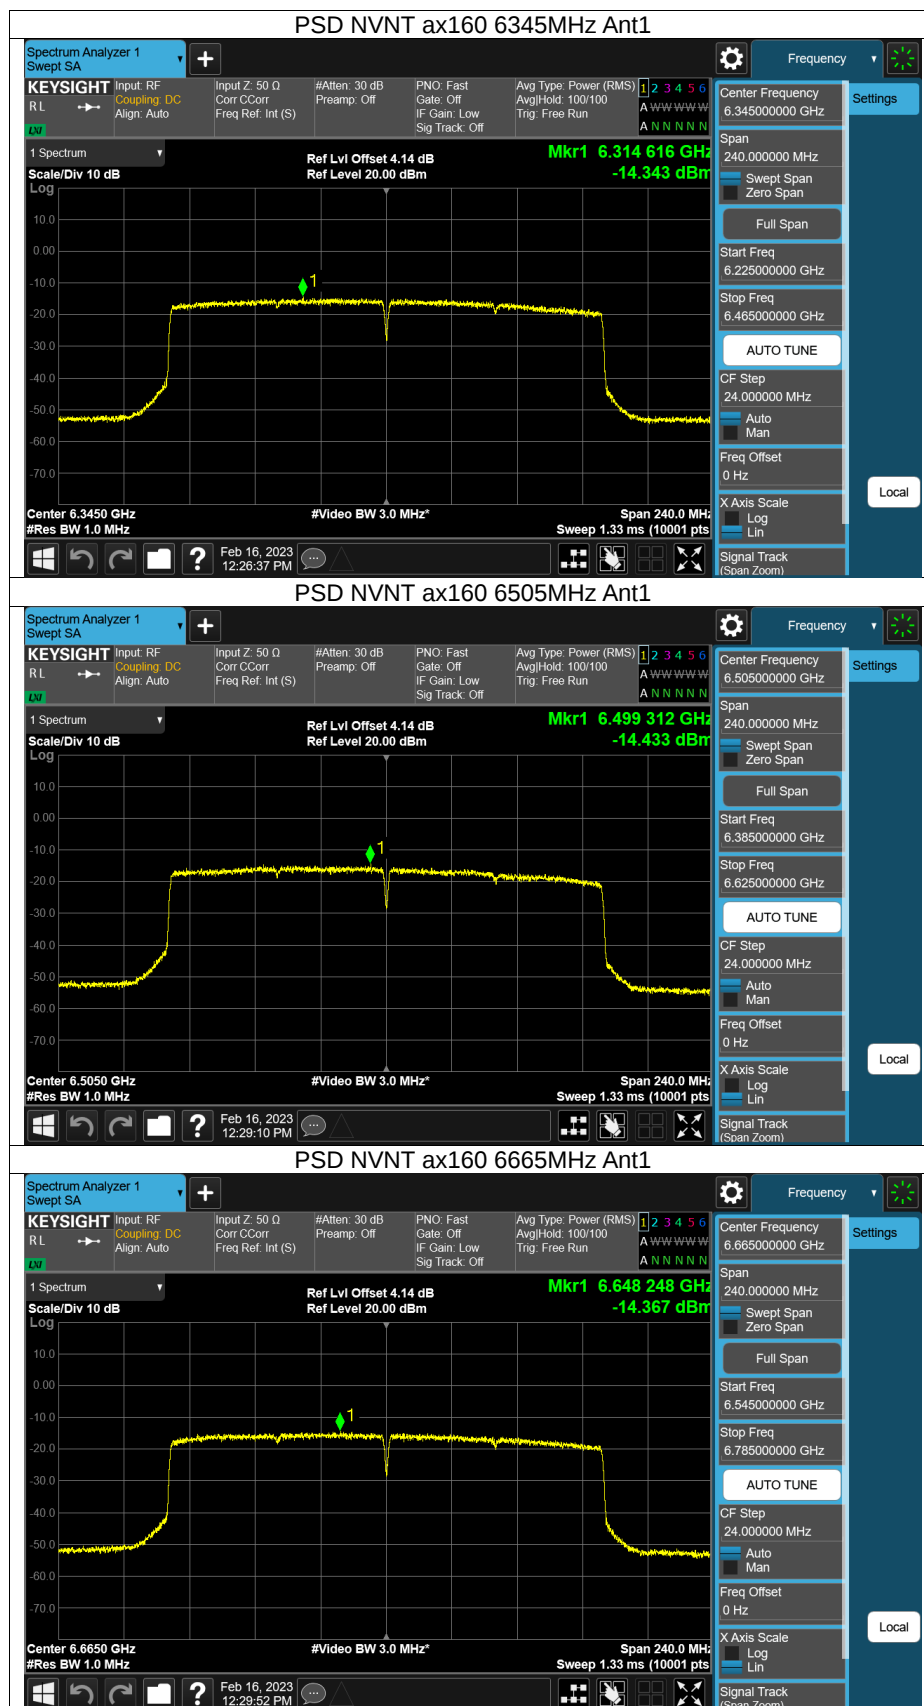









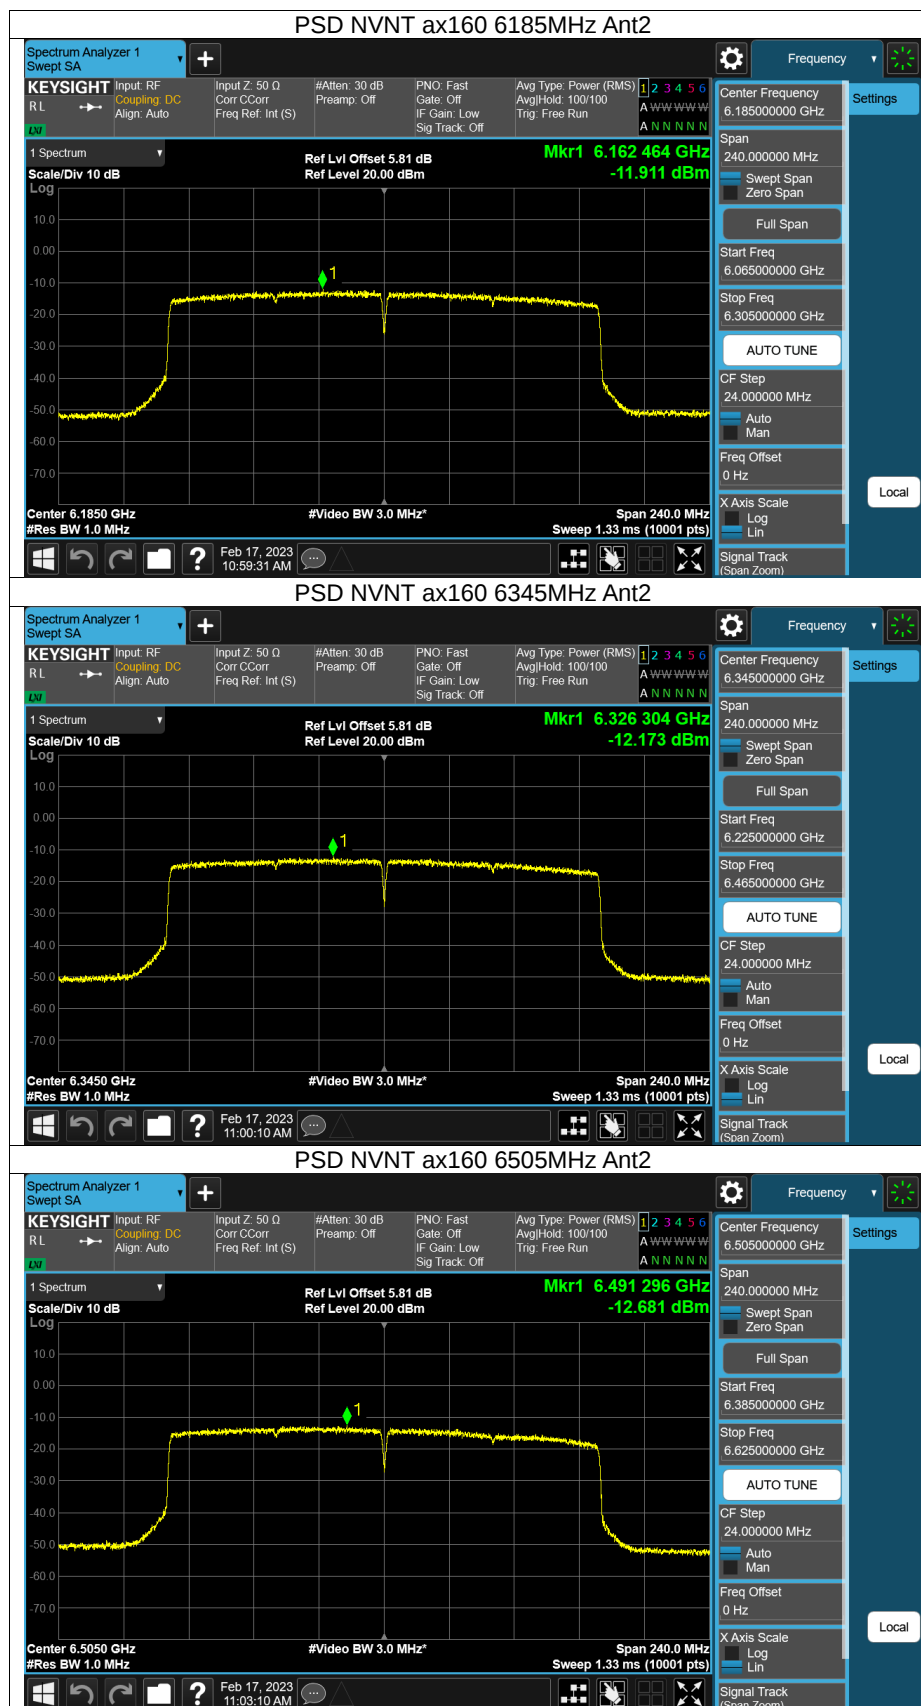


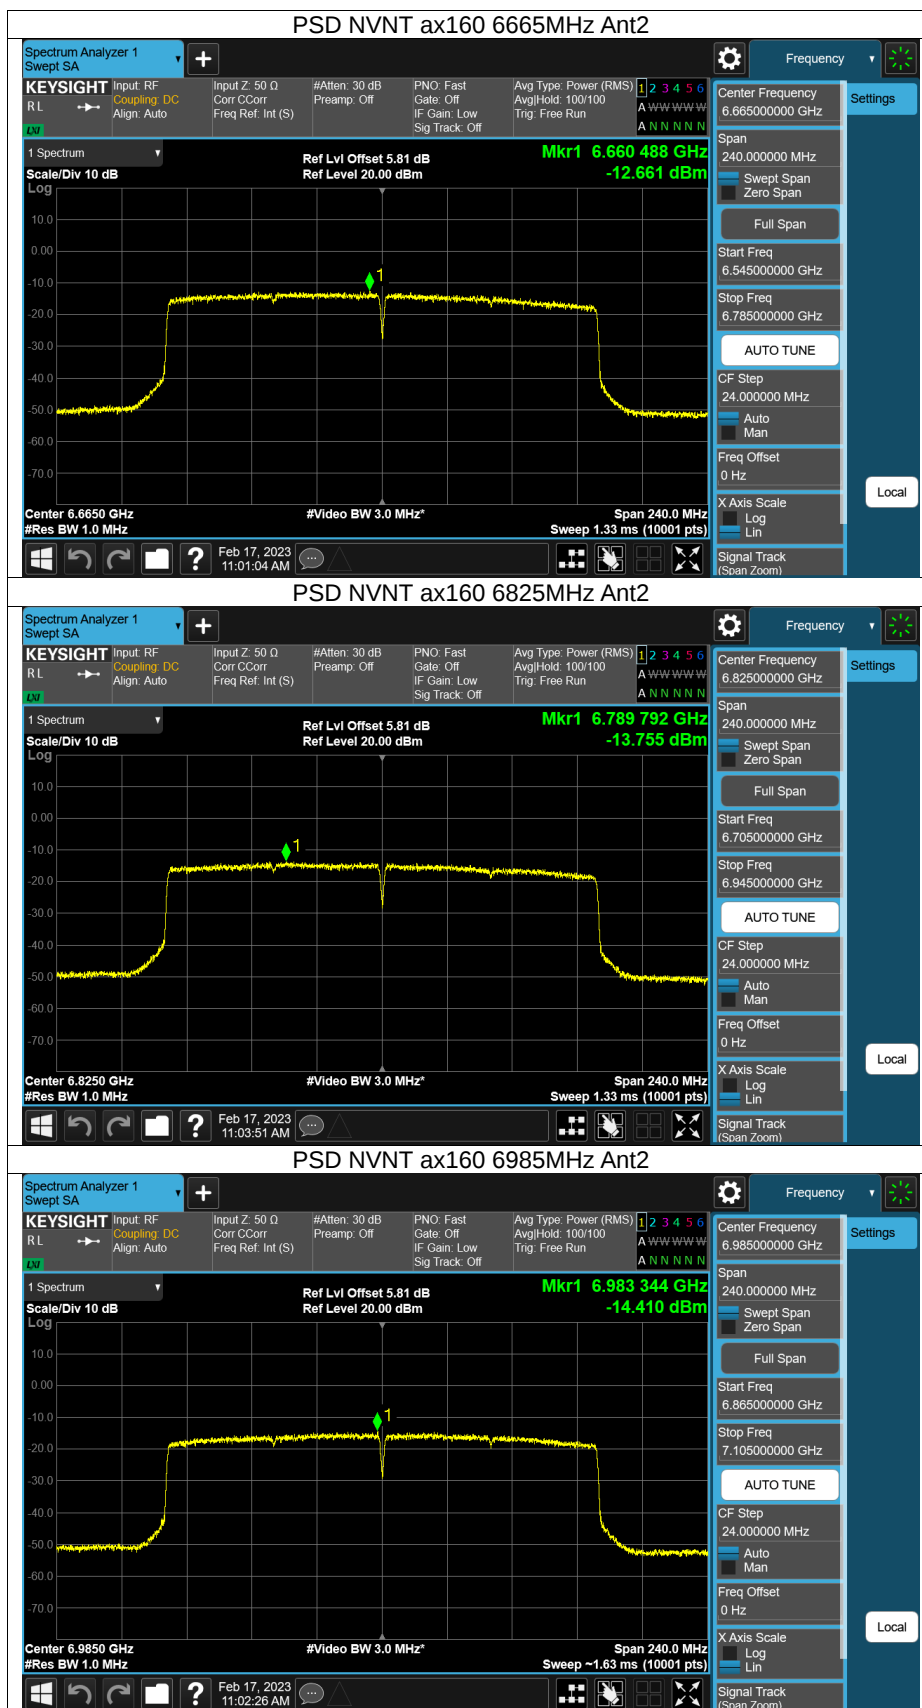


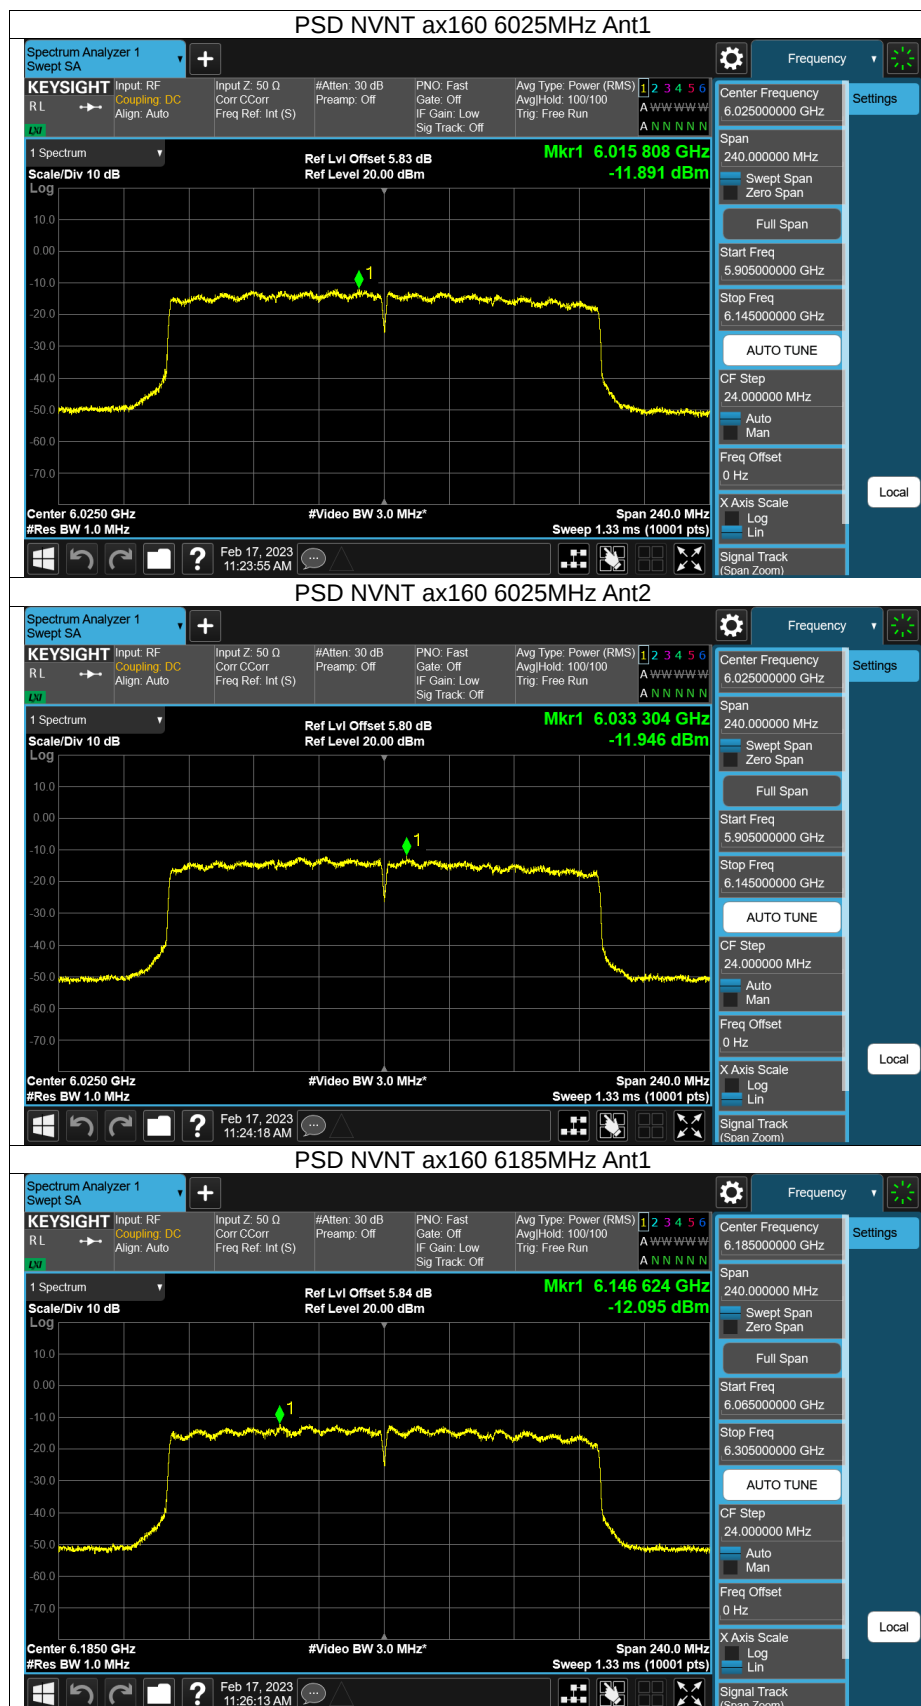

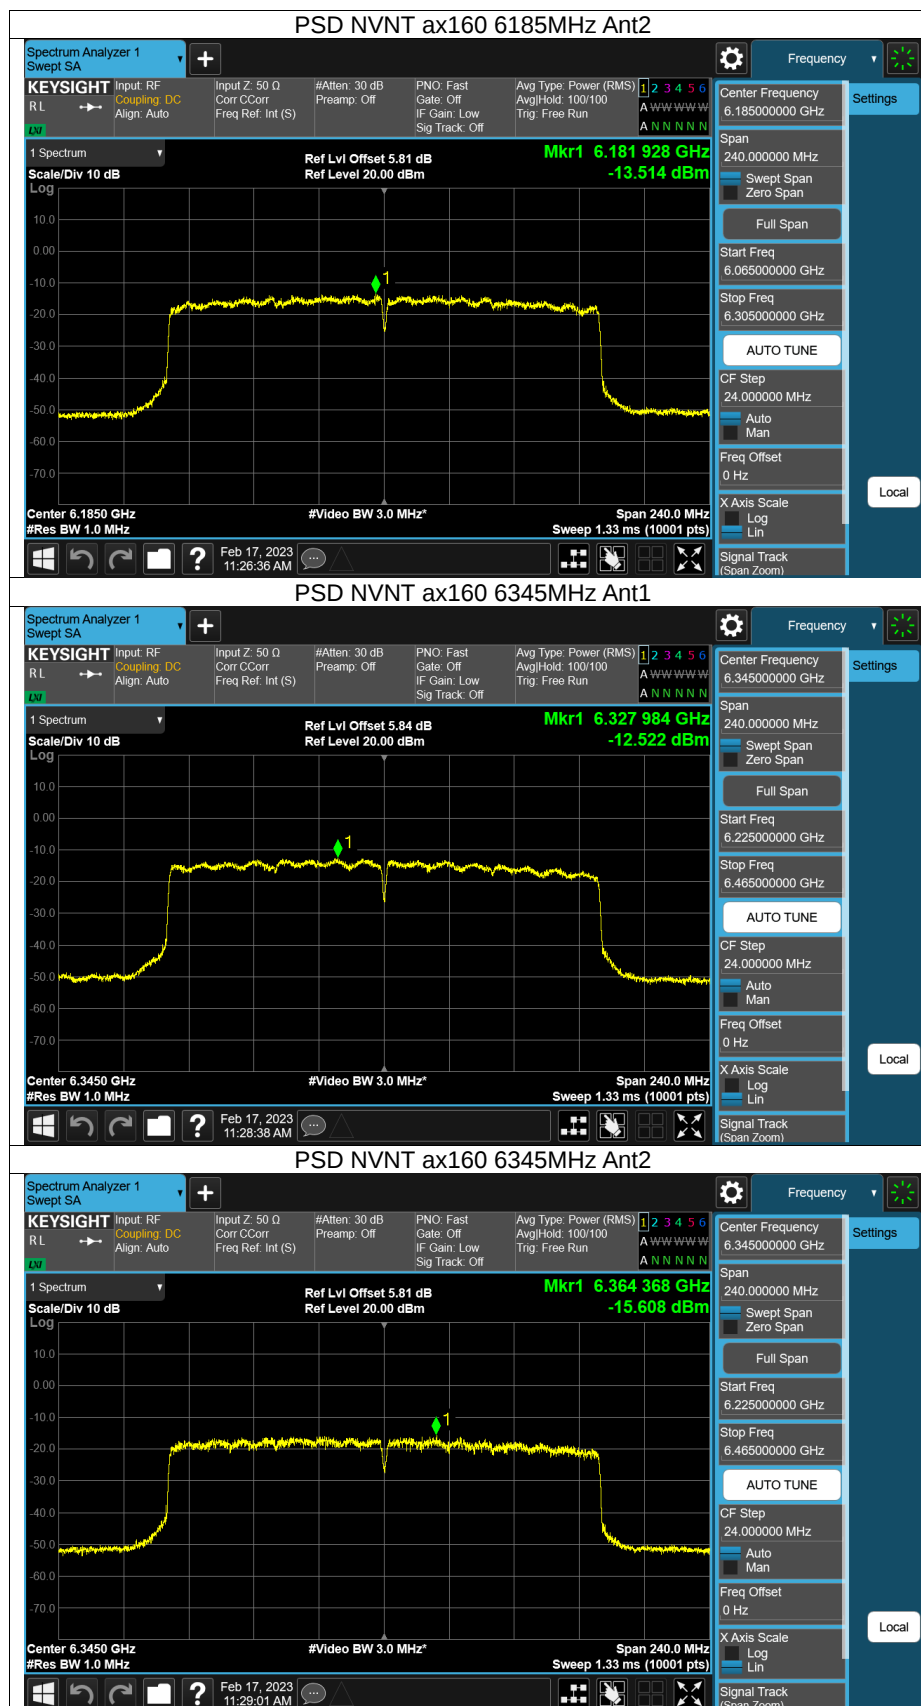

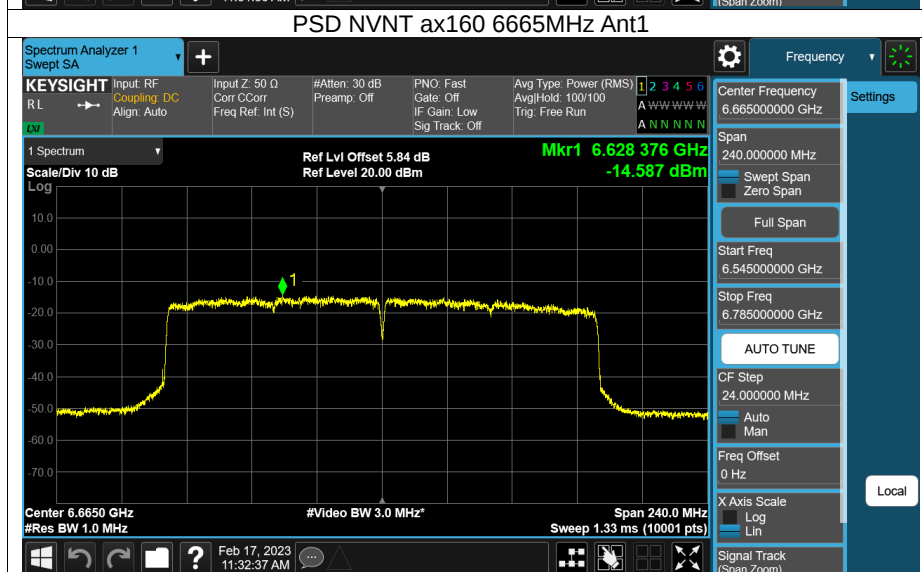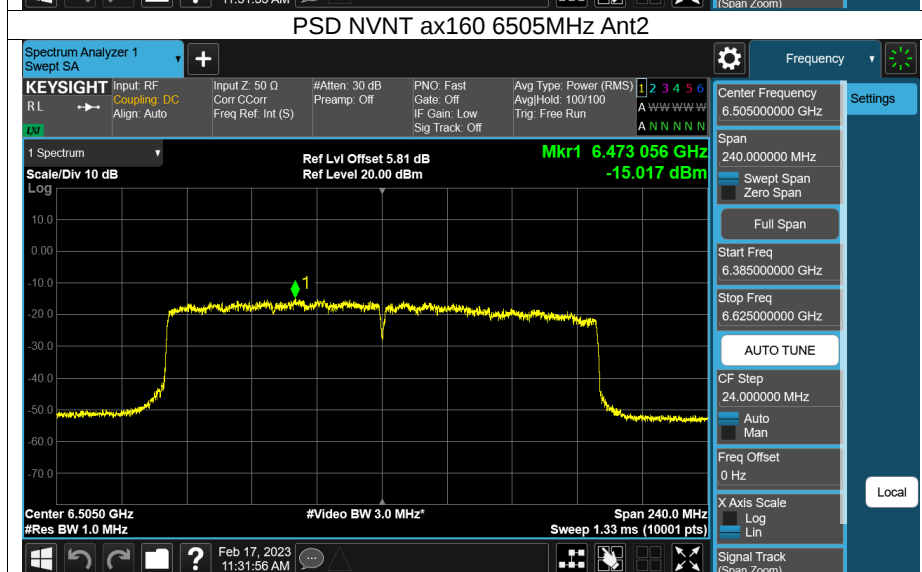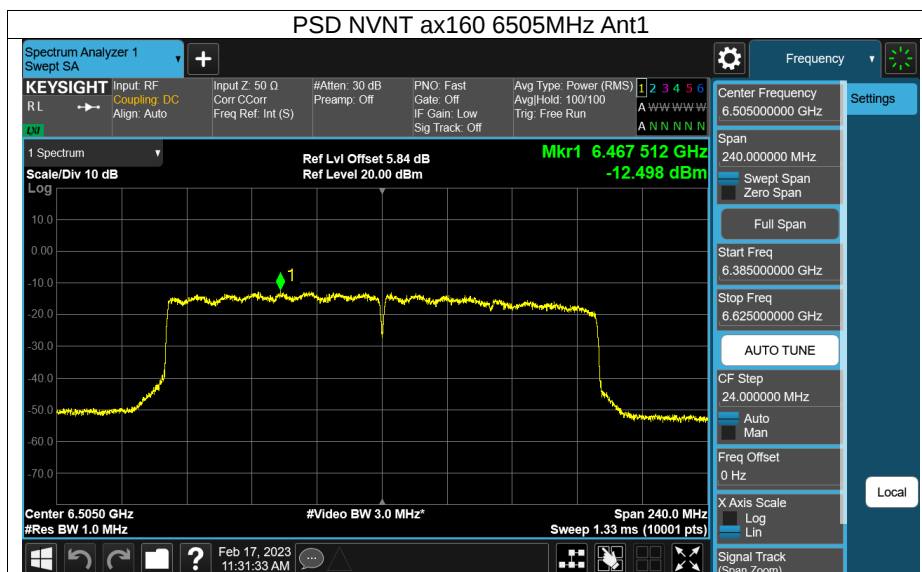

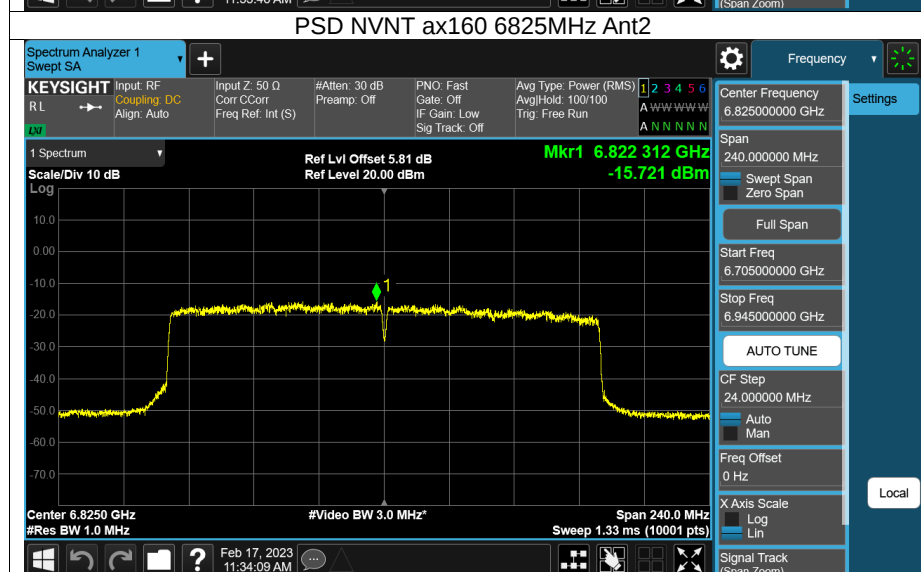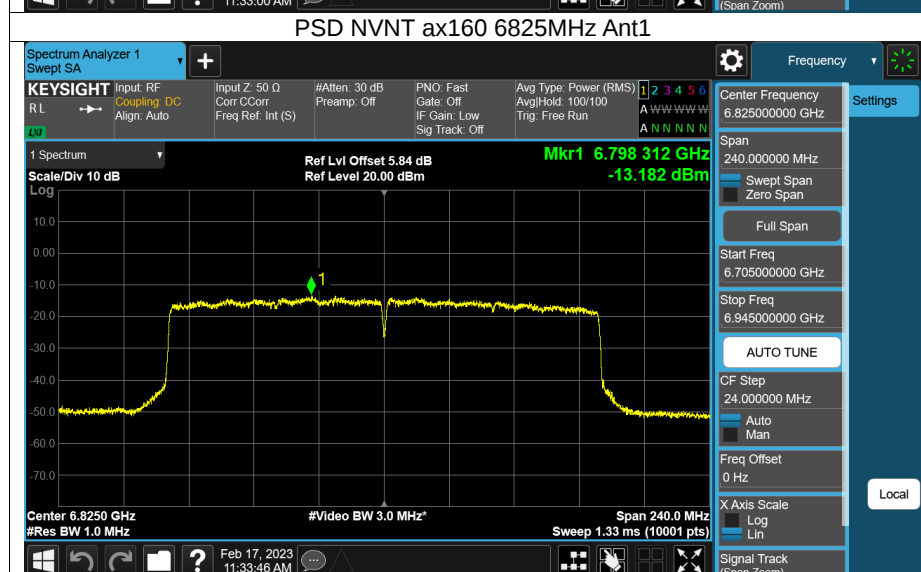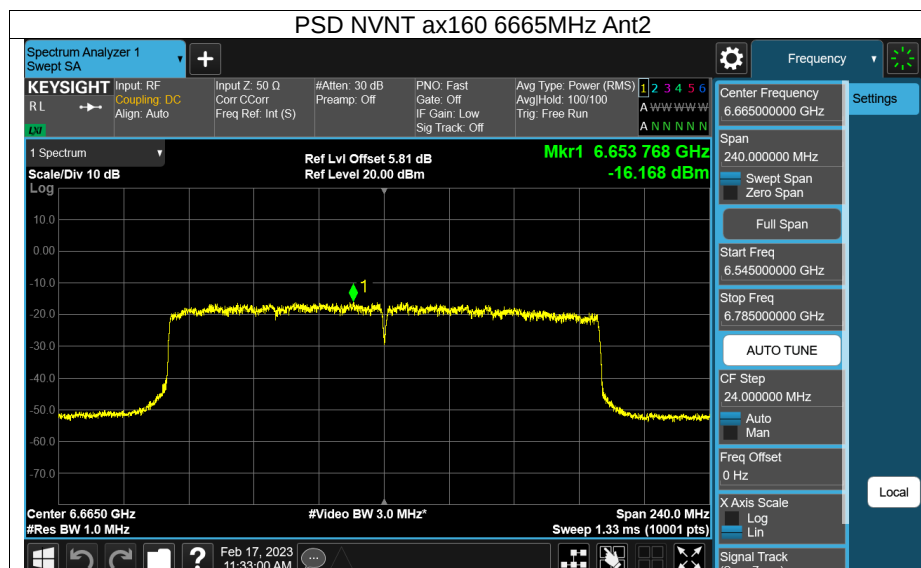

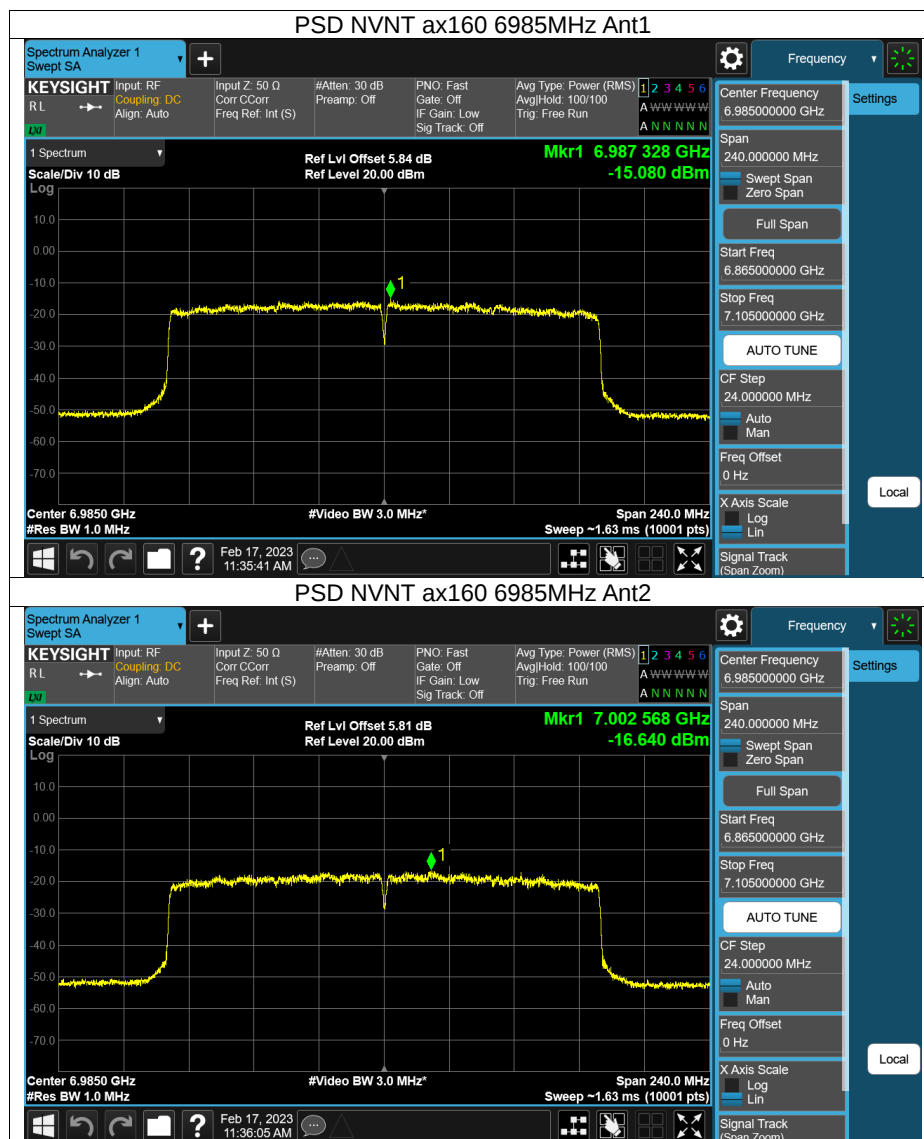



CONDUCTED RF SPURIOUS EMISSION

Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBm)	Limit (dBm)	Verdict
NVNT	a	5955	Ant1	-28.48	-27	Pass
NVNT	a	6175	Ant1	-27.76	-27	Pass
NVNT	a	6415	Ant1	-27.86	-27	Pass
NVNT	a	6435	Ant1	-28.56	-27	Pass
NVNT	a	6475	Ant1	-28.51	-27	Pass
NVNT	a	6515	Ant1	-28.02	-27	Pass
NVNT	a	6535	Ant1	-28.14	-27	Pass
NVNT	a	6695	Ant1	-28.53	-27	Pass
NVNT	a	6855	Ant1	-27.92	-27	Pass
NVNT	a	6895	Ant1	-28.17	-27	Pass
NVNT	a	7115	Ant1	-28.25	-27	Pass
NVNT	a	5955	Ant2	-36.84	-27	Pass
NVNT	a	6175	Ant2	-35.83	-27	Pass
NVNT	a	6415	Ant2	-36.62	-27	Pass
NVNT	a	6435	Ant2	-36.09	-27	Pass
NVNT	a	6475	Ant2	-35.96	-27	Pass
NVNT	a	6515	Ant2	-36.53	-27	Pass
NVNT	a	6535	Ant2	-35.92	-27	Pass
NVNT	a	6695	Ant2	-36.83	-27	Pass
NVNT	a	6855	Ant2	-36.59	-27	Pass
NVNT	a	6895	Ant2	-35.54	-27	Pass
NVNT	a	7115	Ant2	-35.98	-27	Pass
NVNT	n20	5955	Ant1	-28.03	-27	Pass
NVNT	n20	6175	Ant1	-28.28	-27	Pass
NVNT	n20	6415	Ant1	-28.57	-27	Pass
NVNT	n20	6435	Ant1	-28.39	-27	Pass
NVNT	n20	6475	Ant1	-27.23	-27	Pass
NVNT	n20	6515	Ant1	-28.36	-27	Pass
NVNT	n20	6535	Ant1	-28.52	-27	Pass
NVNT	n20	6695	Ant1	-28.22	-27	Pass
NVNT	n20	6855	Ant1	-28.22	-27	Pass
NVNT	n20	6895	Ant1	-27.88	-27	Pass
NVNT	n20	7115	Ant1	-27.78	-27	Pass
NVNT	n20	5955	Ant2	-36.78	-27	Pass
NVNT	n20	6175	Ant2	-36.48	-27	Pass
NVNT	n20	6415	Ant2	-35.93	-27	Pass
NVNT	n20	6435	Ant2	-35.58	-27	Pass
NVNT	n20	6475	Ant2	-36.28	-27	Pass
NVNT	n20	6515	Ant2	-36.89	-27	Pass
NVNT	n20	6535	Ant2	-35.78	-27	Pass
NVNT	n20	6695	Ant2	-36.41	-27	Pass
NVNT	n20	6855	Ant2	-35.1	-27	Pass
NVNT	n20	6895	Ant2	-36.06	-27	Pass
NVNT	n20	7115	Ant2	-36.69	-27	Pass
NVNT	n40	5965	Ant1	-28.33	-27	Pass
NVNT	n40	6165	Ant1	-28.24	-27	Pass
NVNT	n40	6405	Ant1	-28.52	-27	Pass
NVNT	n40	6445	Ant1	-28.82	-27	Pass
NVNT	n40	6485	Ant1	-28.33	-27	Pass
NVNT	n40	6525	Ant1	-28.65	-27	Pass
NVNT	n40	6565	Ant1	-27.83	-27	Pass
NVNT	n40	6685	Ant1	-28.34	-27	Pass
NVNT	n40	6845	Ant1	-28.61	-27	Pass
NVNT	n40	6885	Ant1	-27.55	-27	Pass
NVNT	n40	6925	Ant1	-28.09	-27	Pass
NVNT	n40	6965	Ant1	-28.8	-27	Pass
NVNT	n40	7085	Ant1	-28.9	-27	Pass
NVNT	n40	5965	Ant2	-35.77	-27	Pass
NVNT	n40	6165	Ant2	-36.76	-27	Pass
NVNT	n40	6405	Ant2	-36.83	-27	Pass
NVNT	n40	6445	Ant2	-36.26	-27	Pass
NVNT	n40	6485	Ant2	-36.85	-27	Pass
NVNT	n40	6525	Ant2	-35.48	-27	Pass
NVNT	n40	6565	Ant2	-36.66	-27	Pass
NVNT	n40	6685	Ant2	-36.35	-27	Pass



NVNT	n40	6845	Ant2	-36.64	-27	Pass
NVNT	n40	6885	Ant2	-35.83	-27	Pass
NVNT	n40	6925	Ant2	-36.97	-27	Pass
NVNT	n40	6965	Ant2	-36.56	-27	Pass
NVNT	n40	7085	Ant2	-36.37	-27	Pass
NVNT	ac80	5985	Ant1	-27.9	-27	Pass
NVNT	ac80	6145	Ant1	-28.3	-27	Pass
NVNT	ac80	6385	Ant1	-28.41	-27	Pass
NVNT	ac80	6465	Ant1	-28.27	-27	Pass
NVNT	ac80	6545	Ant1	-28.56	-27	Pass
NVNT	ac80	6625	Ant1	-29.01	-27	Pass
NVNT	ac80	6705	Ant1	-27.71	-27	Pass
NVNT	ac80	6785	Ant1	-28.56	-27	Pass
NVNT	ac80	6865	Ant1	-27.63	-27	Pass
NVNT	ac80	6945	Ant1	-28.17	-27	Pass
NVNT	ac80	7025	Ant1	-28.68	-27	Pass
NVNT	ac80	5985	Ant2	-36.45	-27	Pass
NVNT	ac80	6145	Ant2	-36.12	-27	Pass
NVNT	ac80	6385	Ant2	-35.18	-27	Pass
NVNT	ac80	6465	Ant2	-35.89	-27	Pass
NVNT	ac80	6545	Ant2	-35.18	-27	Pass
NVNT	ac80	6625	Ant2	-36.22	-27	Pass
NVNT	ac80	6705	Ant2	-35.79	-27	Pass
NVNT	ac80	6785	Ant2	-35.79	-27	Pass
NVNT	ac80	6865	Ant2	-36.56	-27	Pass
NVNT	ac80	6945	Ant2	-35.37	-27	Pass
NVNT	ac80	7025	Ant2	-36.79	-27	Pass
NVNT	ax80	5985	Ant1	-27.68	-27	Pass
NVNT	ax80	6145	Ant1	-28.17	-27	Pass
NVNT	ax80	6385	Ant1	-28.06	-27	Pass
NVNT	ax80	6465	Ant1	-27.51	-27	Pass
NVNT	ax80	6545	Ant1	-27.86	-27	Pass
NVNT	ax80	6625	Ant1	-28.36	-27	Pass
NVNT	ax80	6705	Ant1	-28.27	-27	Pass
NVNT	ax80	6785	Ant1	-27.93	-27	Pass
NVNT	ax80	6865	Ant1	-27.9	-27	Pass
NVNT	ax80	6945	Ant1	-27.48	-27	Pass
NVNT	ax80	7025	Ant1	-28.89	-27	Pass
NVNT	ax80	5985	Ant2	-36.33	-27	Pass
NVNT	ax80	6145	Ant2	-36.59	-27	Pass
NVNT	ax80	6385	Ant2	-35.91	-27	Pass
NVNT	ax80	6465	Ant2	-35.36	-27	Pass
NVNT	ax80	6545	Ant2	-35.73	-27	Pass
NVNT	ax80	6625	Ant2	-36.43	-27	Pass
NVNT	ax80	6705	Ant2	-35.13	-27	Pass
NVNT	ax80	6785	Ant2	-36.5	-27	Pass
NVNT	ax80	6865	Ant2	-35.91	-27	Pass
NVNT	ax80	6945	Ant2	-36.58	-27	Pass
NVNT	ax80	7025	Ant2	-35.71	-27	Pass
NVNT	ax160	6025	Ant1	-28.53	-27	Pass
NVNT	ax160	6185	Ant1	-28.01	-27	Pass
NVNT	ax160	6345	Ant1	-28.64	-27	Pass
NVNT	ax160	6505	Ant1	-28.24	-27	Pass
NVNT	ax160	6665	Ant1	-27.38	-27	Pass
NVNT	ax160	6825	Ant1	-28.53	-27	Pass
NVNT	ax160	6985	Ant1	-28.29	-27	Pass
NVNT	ax160	6025	Ant2	-27.09	-27	Pass
NVNT	ax160	6345	Ant2	-35.73	-27	Pass
NVNT	ax160	6505	Ant2	-35.73	-27	Pass
NVNT	ax160	6665	Ant2	-36.68	-27	Pass
NVNT	ax160	6825	Ant2	-35.64	-27	Pass
NVNT	ax160	6985	Ant2	-36.77	-27	Pass

