




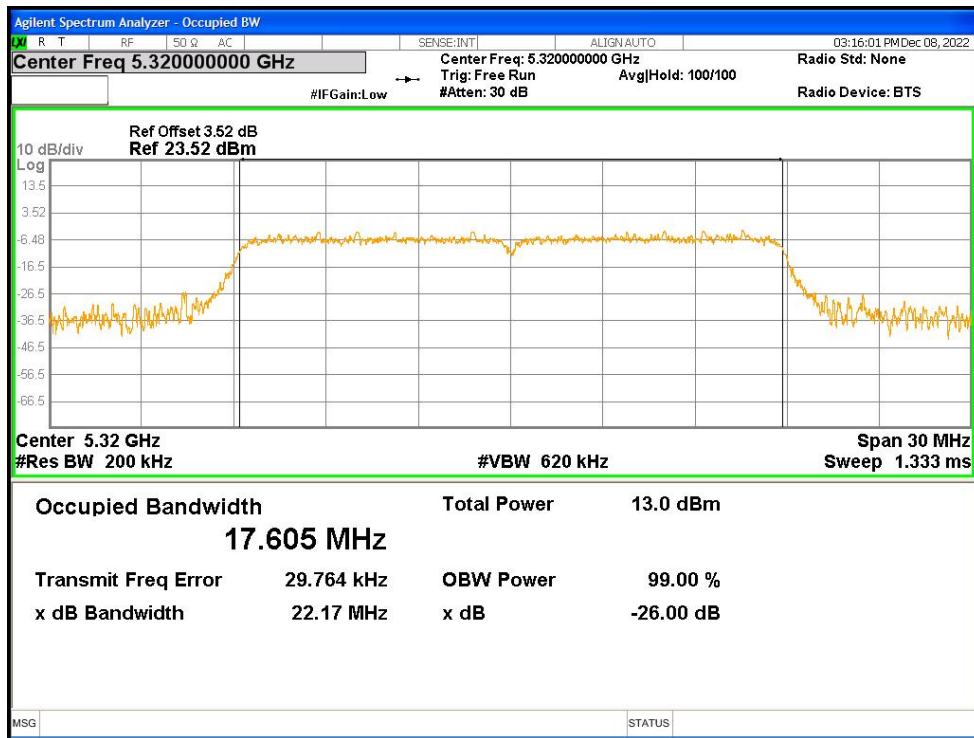


OBW NVNT n20 5320MHz Ant2

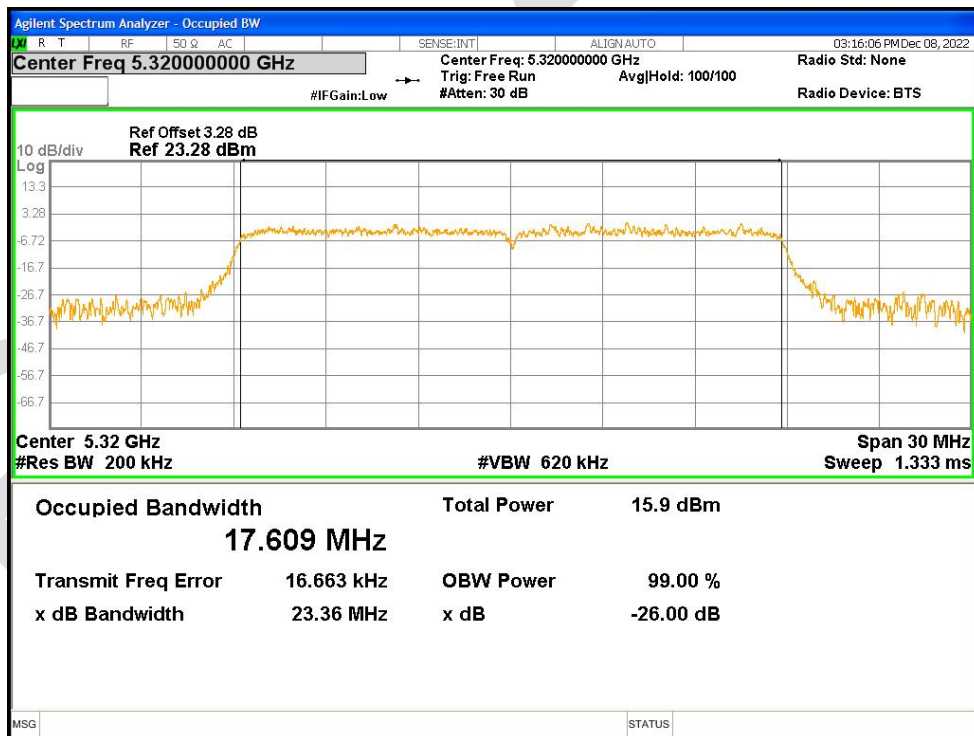


OBW NVNT n20 5500MHz Ant1

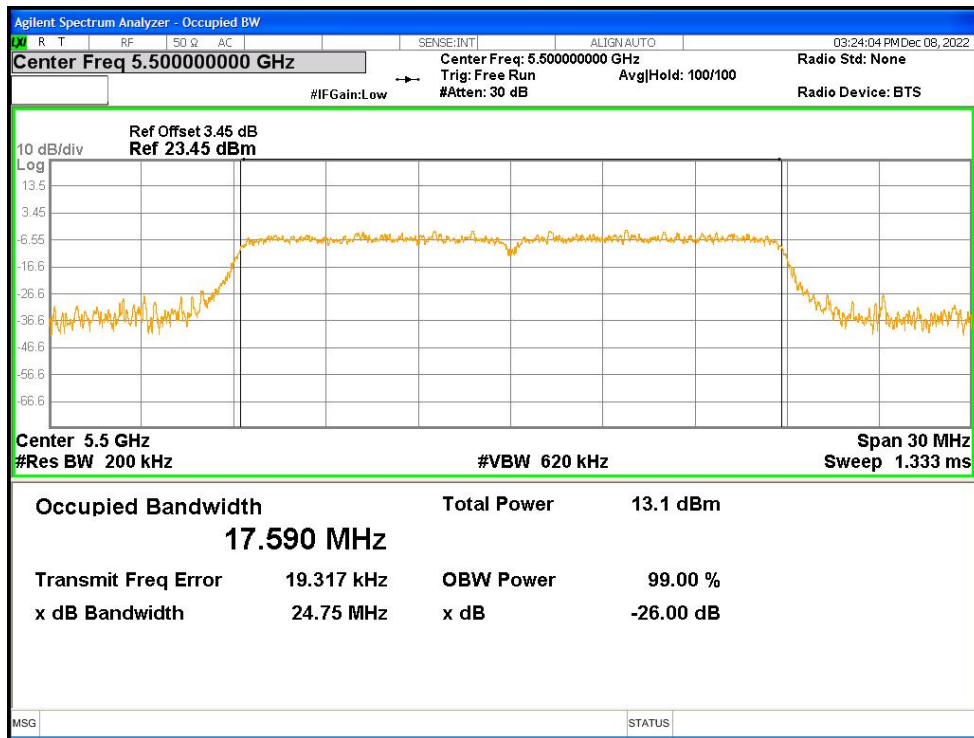


OBW NVNT n20 5500MHz Ant2

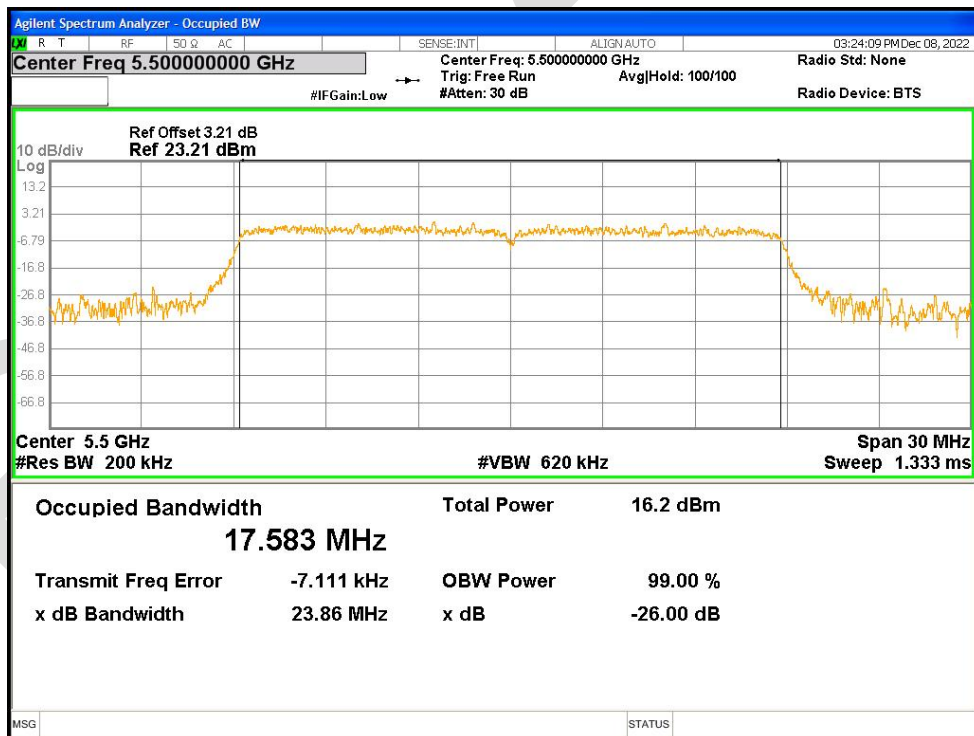


OBW NVNT n20 5600MHz Ant1

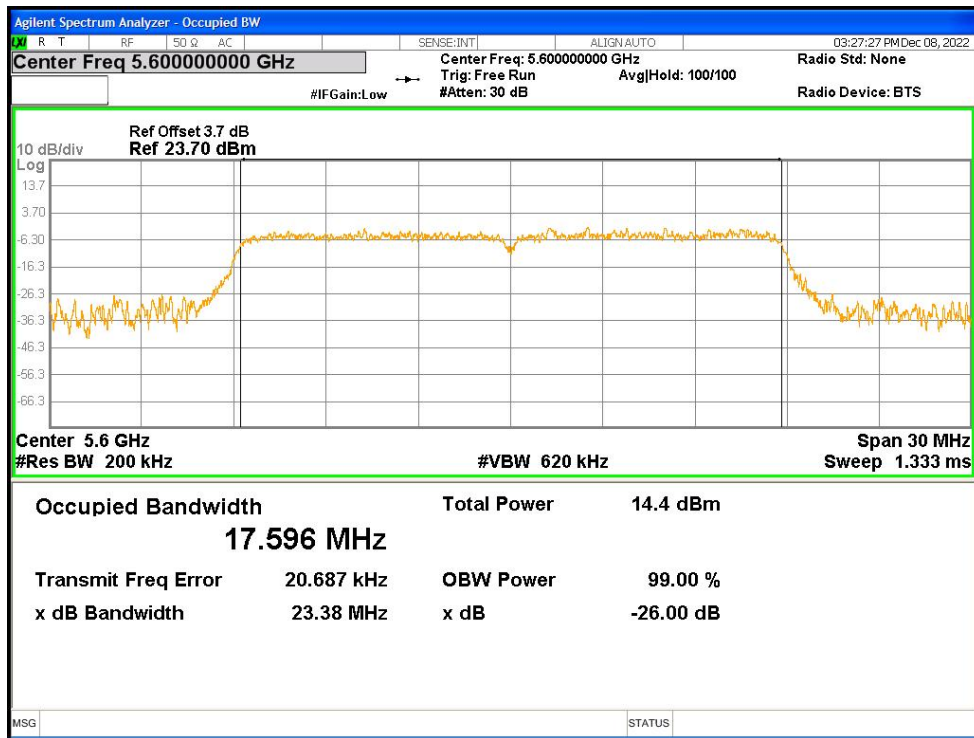


OBW NVNT n20 5600MHz Ant2

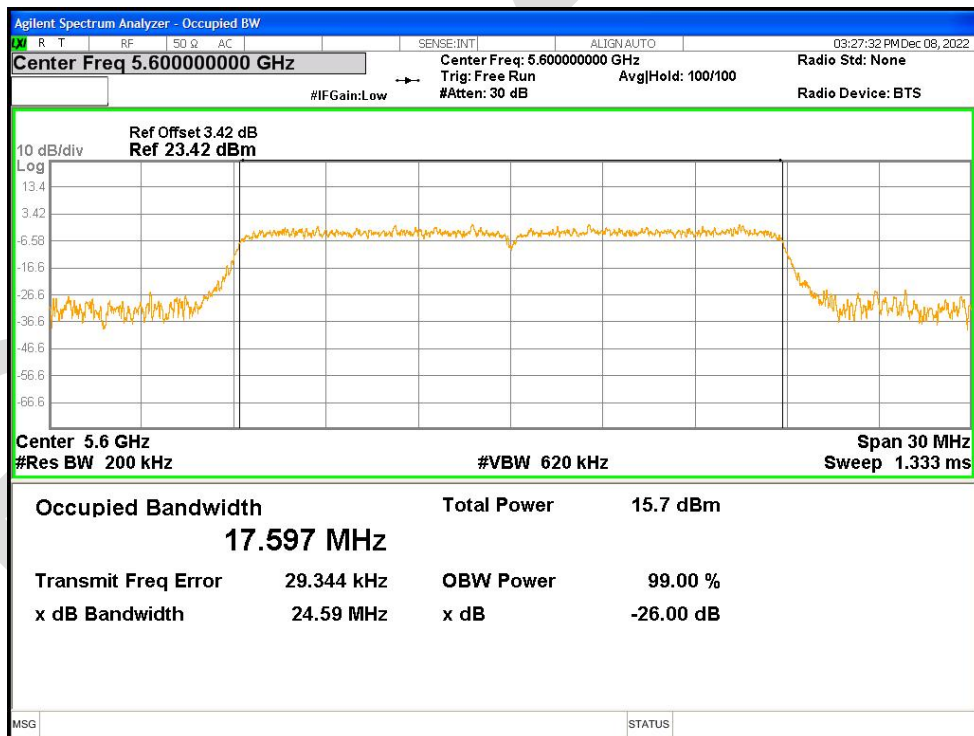


OBW NVNT n20 5700MHz Ant1

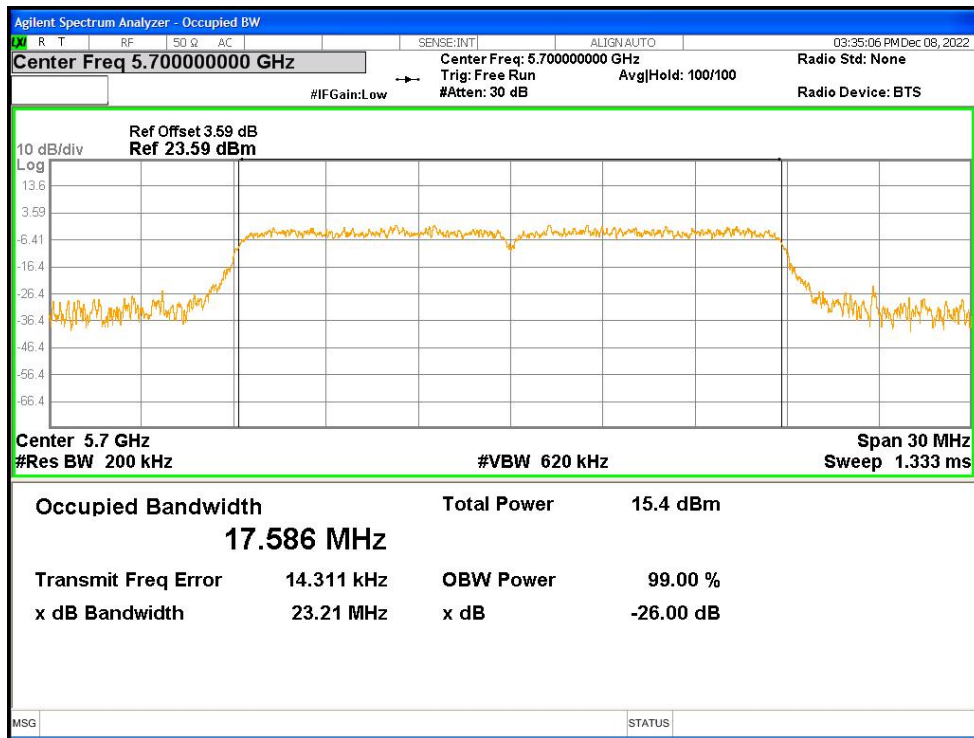


OBW NVNT n20 5700MHz Ant2

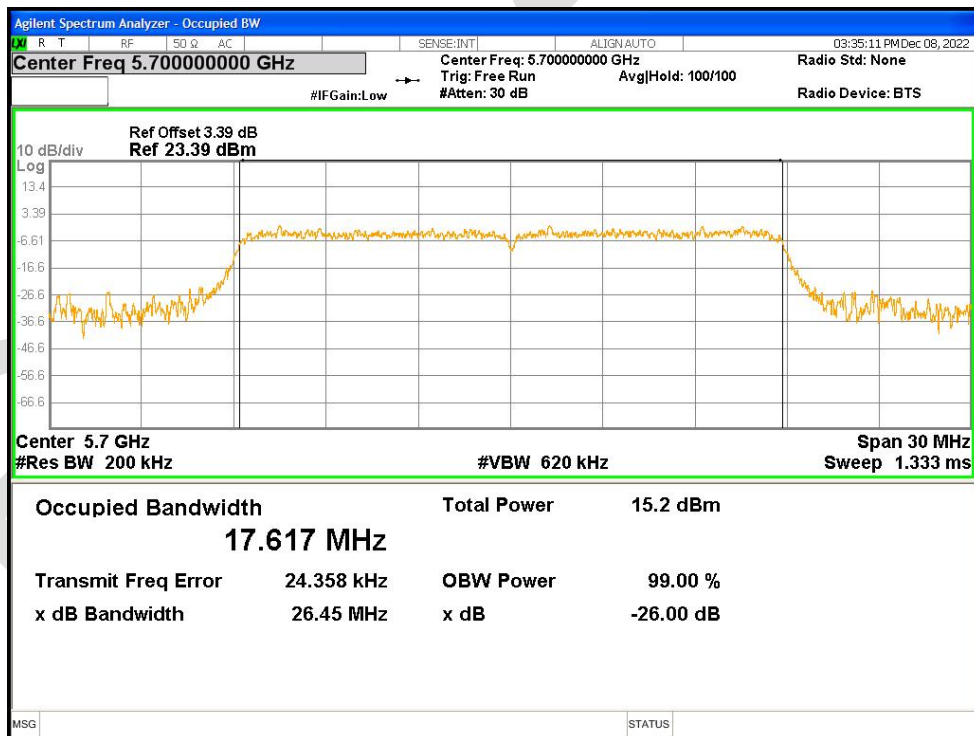


OBW NVNT n20 5745MHz Ant1

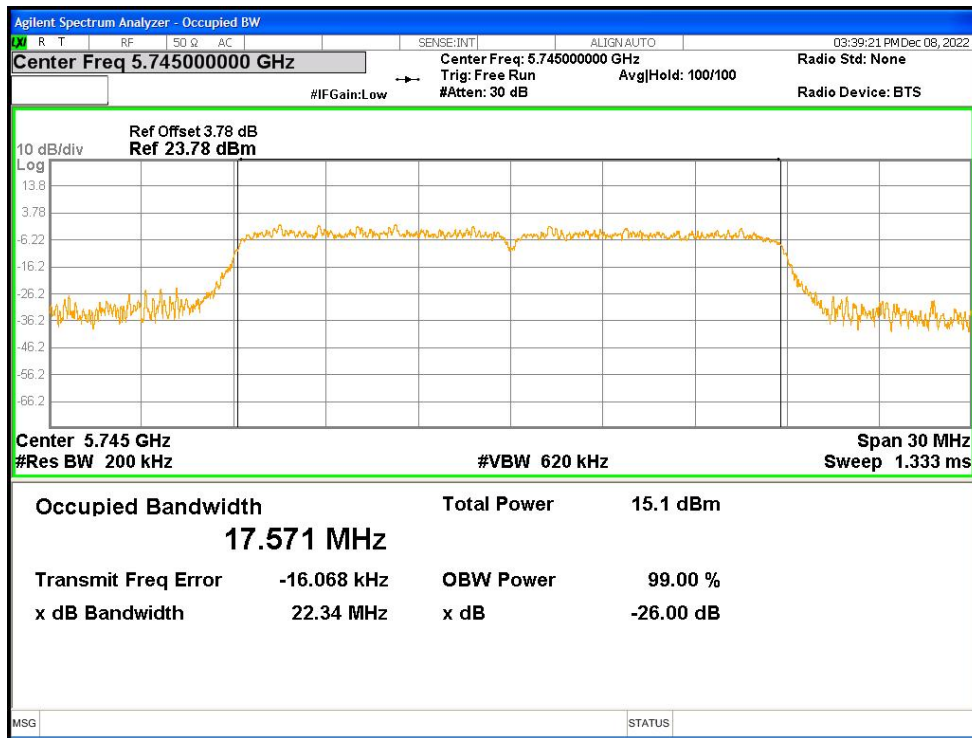


OBW NVNT n20 5745MHz Ant2

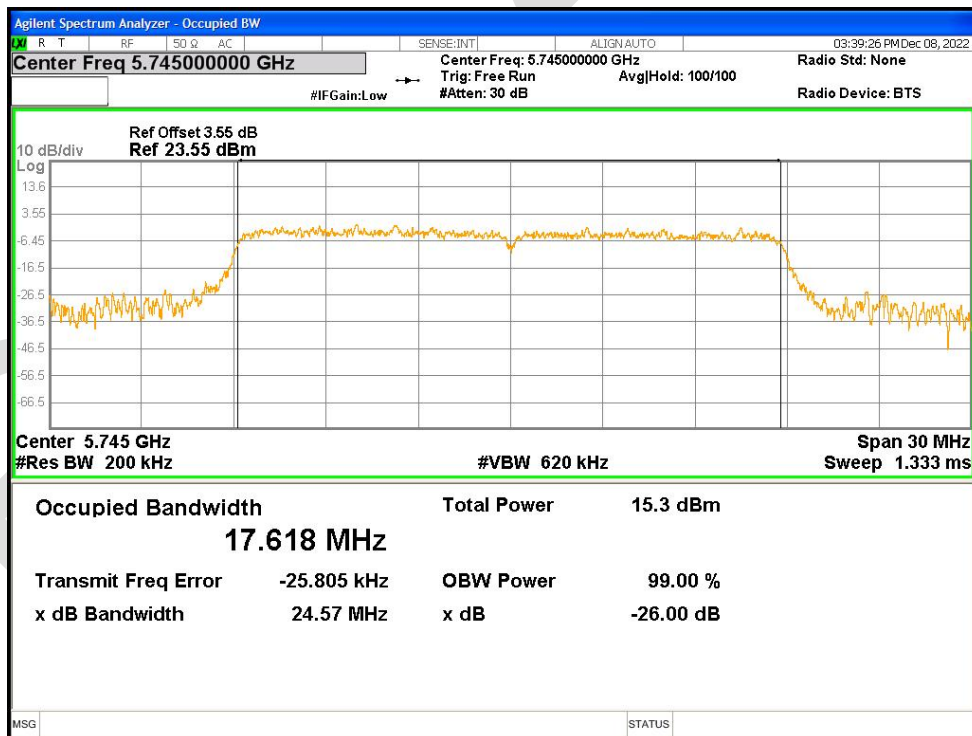


OBW NVNT n20 5785MHz Ant1

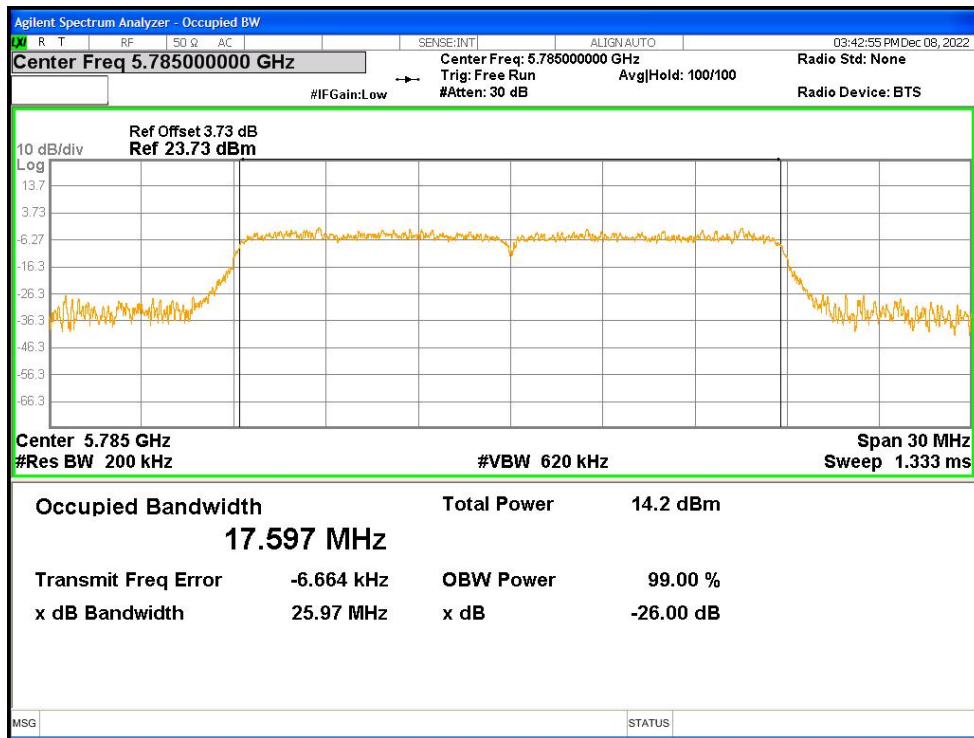


OBW NVNT n20 5785MHz Ant2

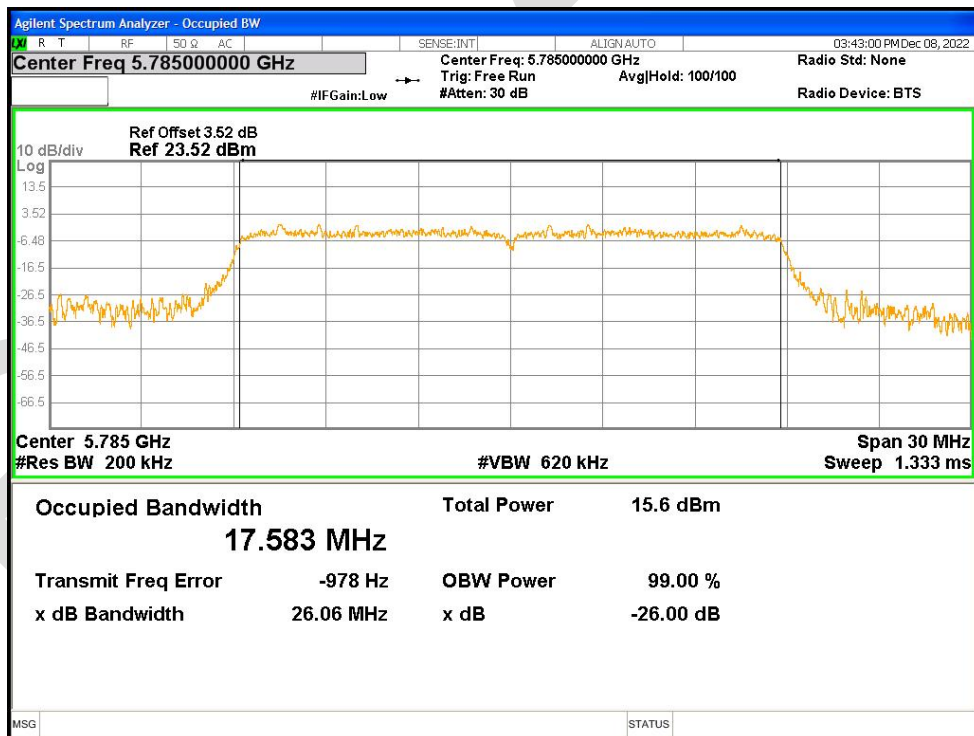


OBW NVNT n20 5825MHz Ant1

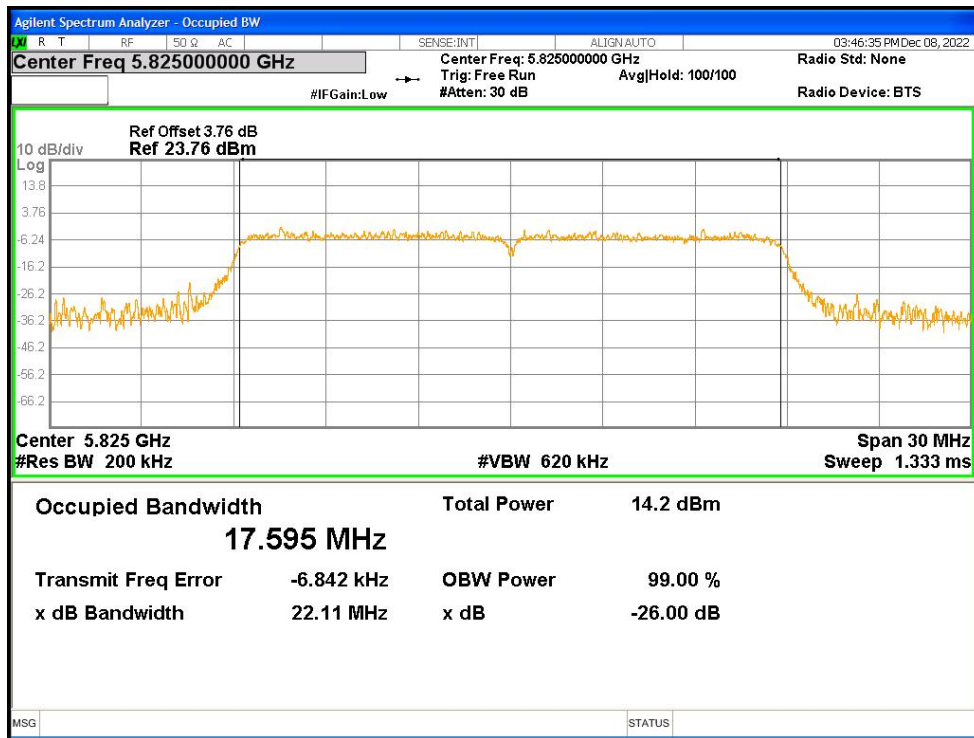


OBW NVNT n20 5825MHz Ant2

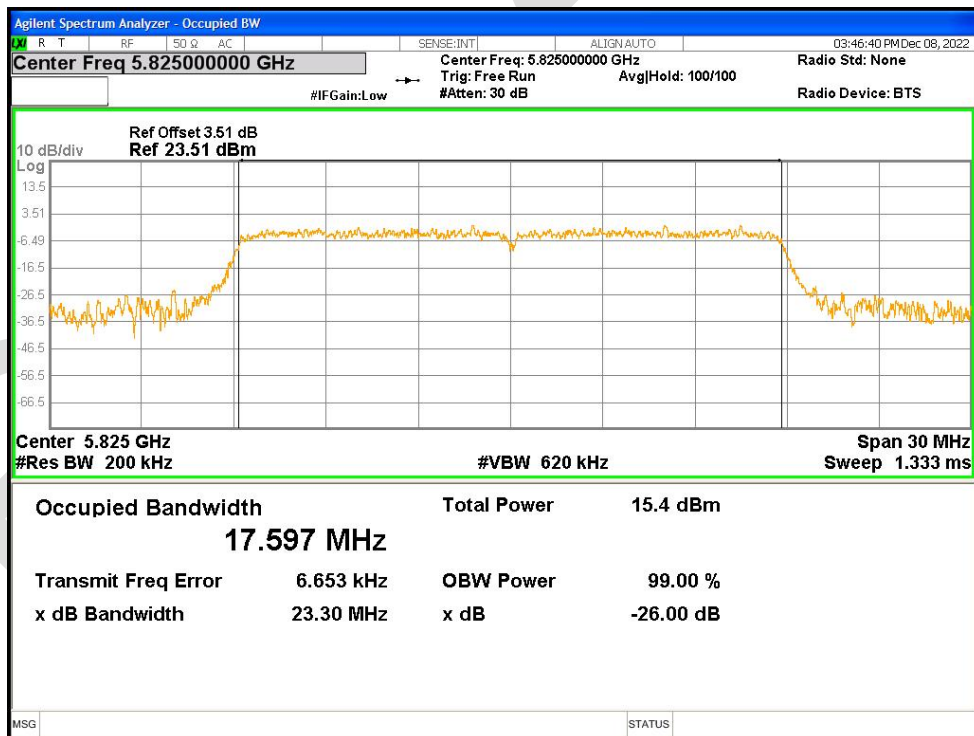


OBW NVNT n40 5190MHz Ant1

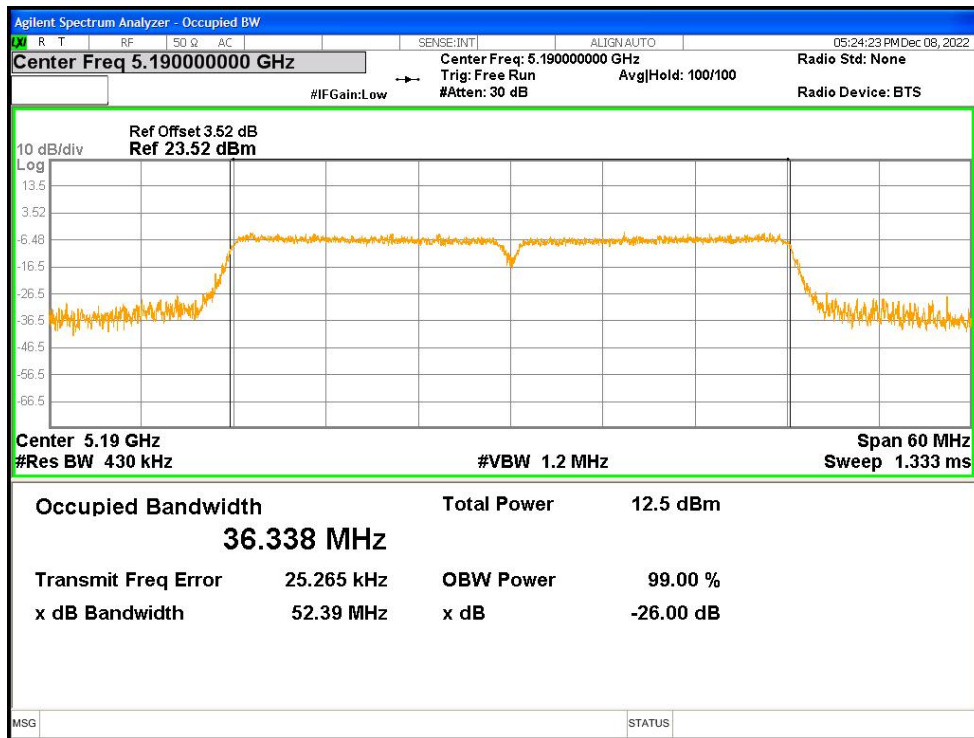


OBW NVNT n40 5190MHz Ant2

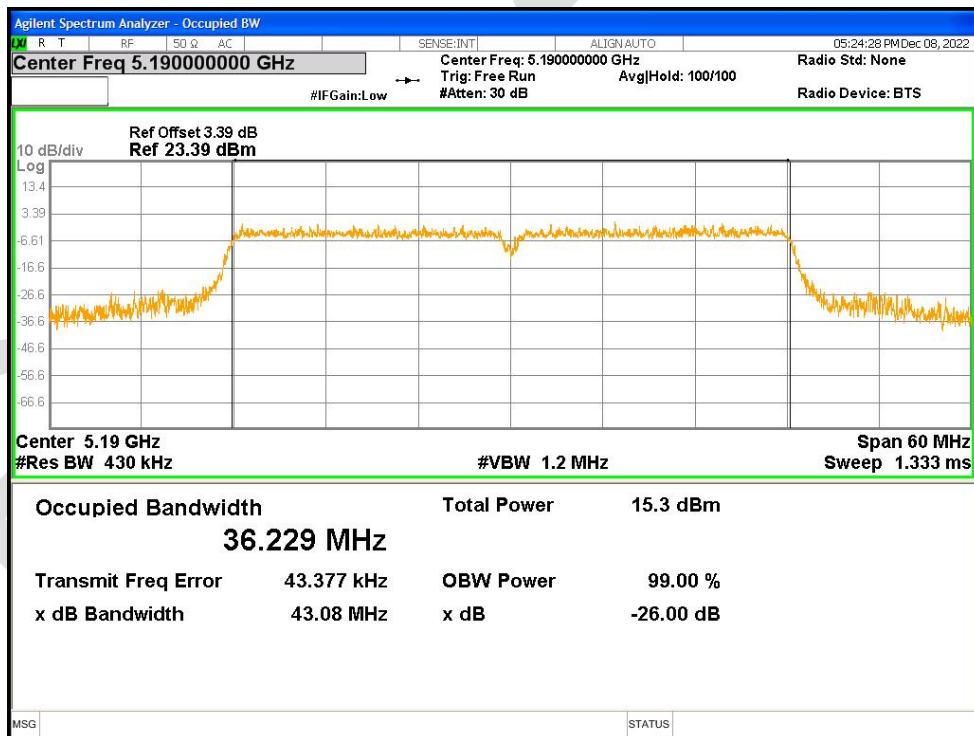


OBW NVNT n40 5230MHz Ant1

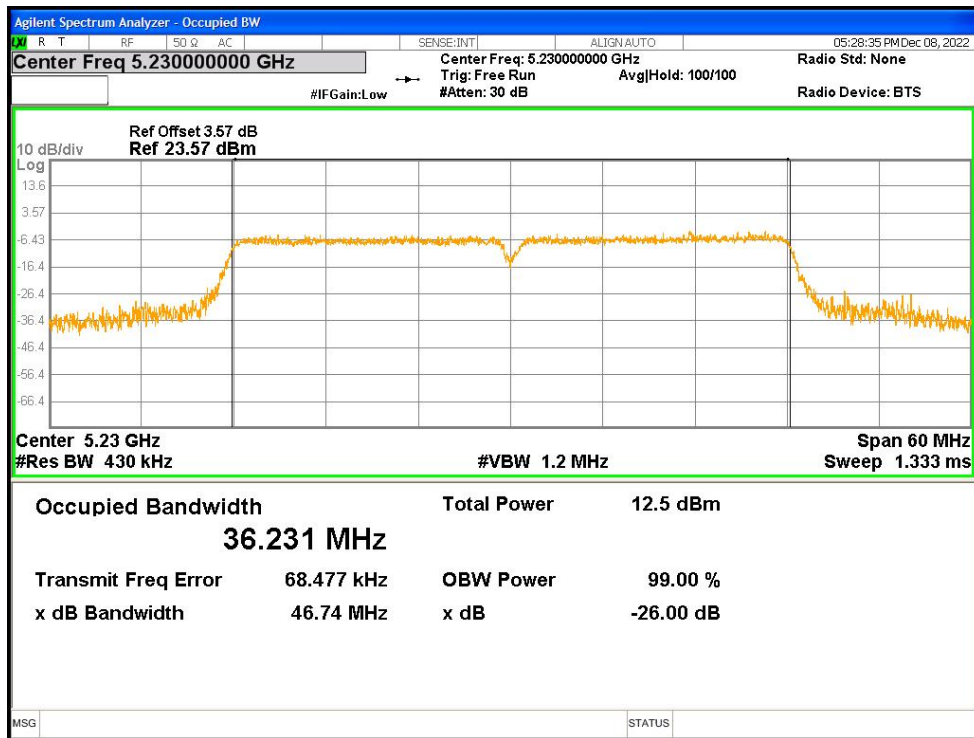


OBW NVNT n40 5230MHz Ant2

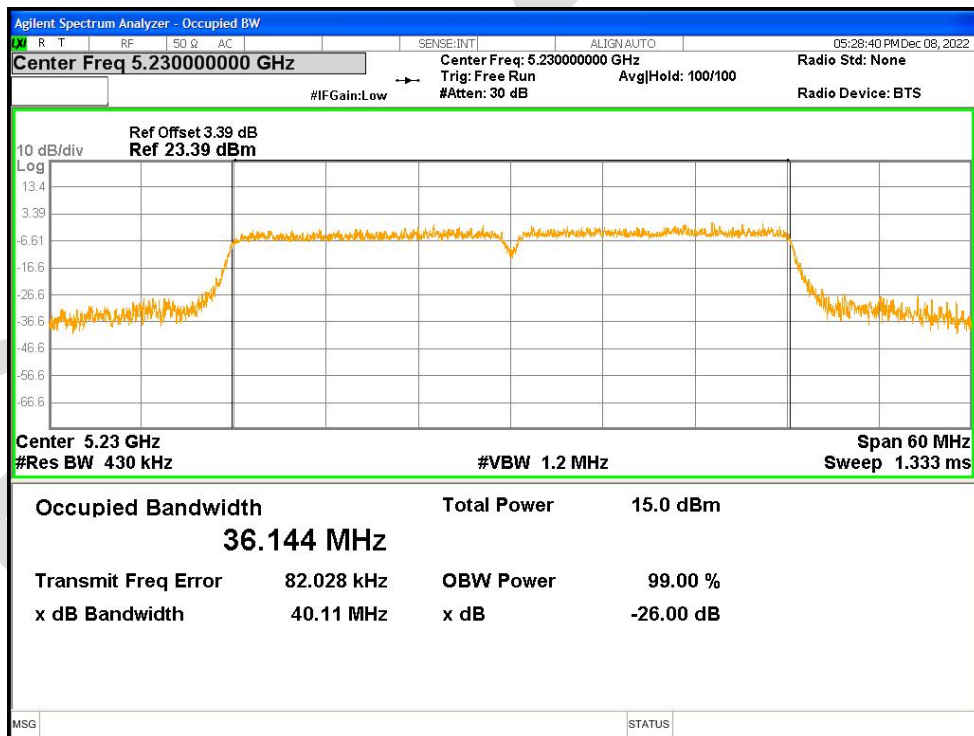


OBW NVNT n40 5270MHz Ant1

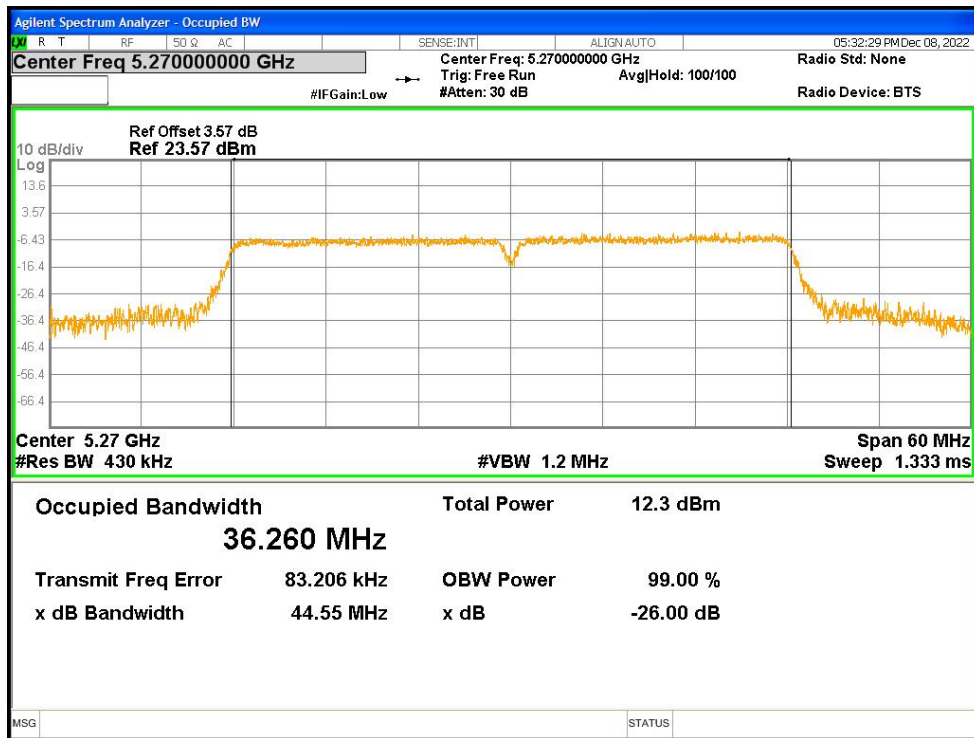


OBW NVNT n40 5270MHz Ant2

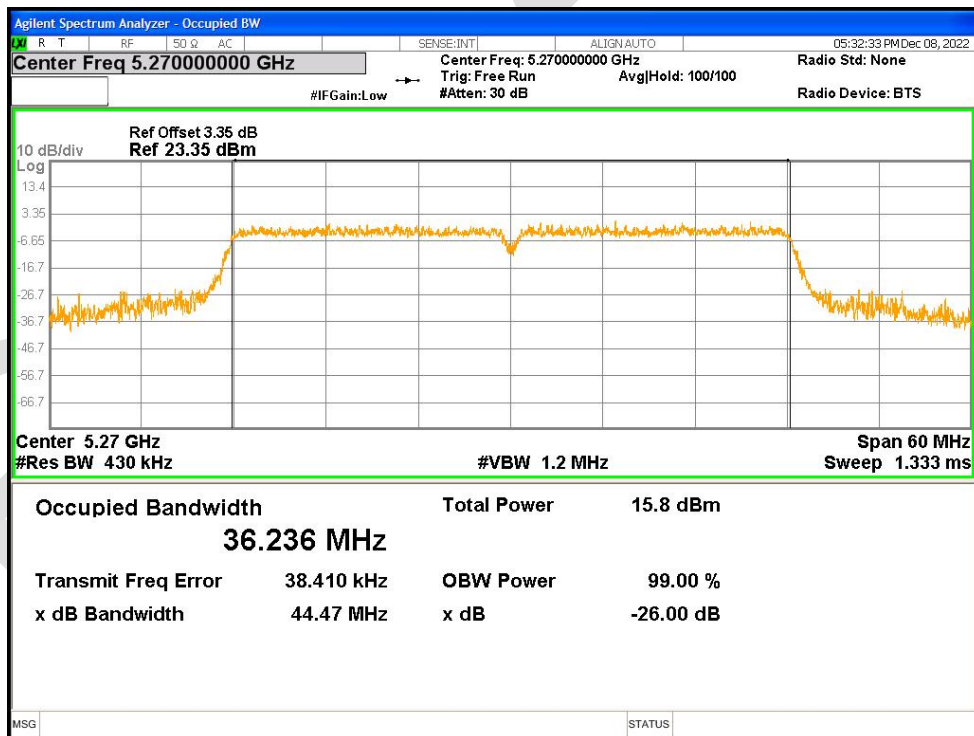


OBW NVNT n40 5310MHz Ant1

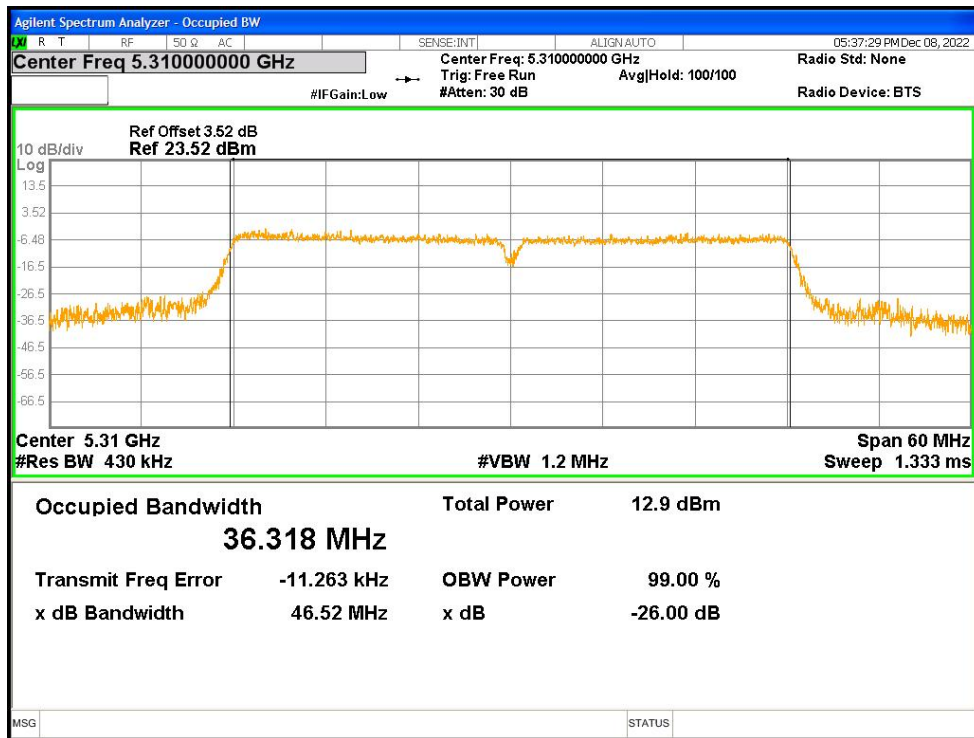


OBW NVNT n40 5310MHz Ant2

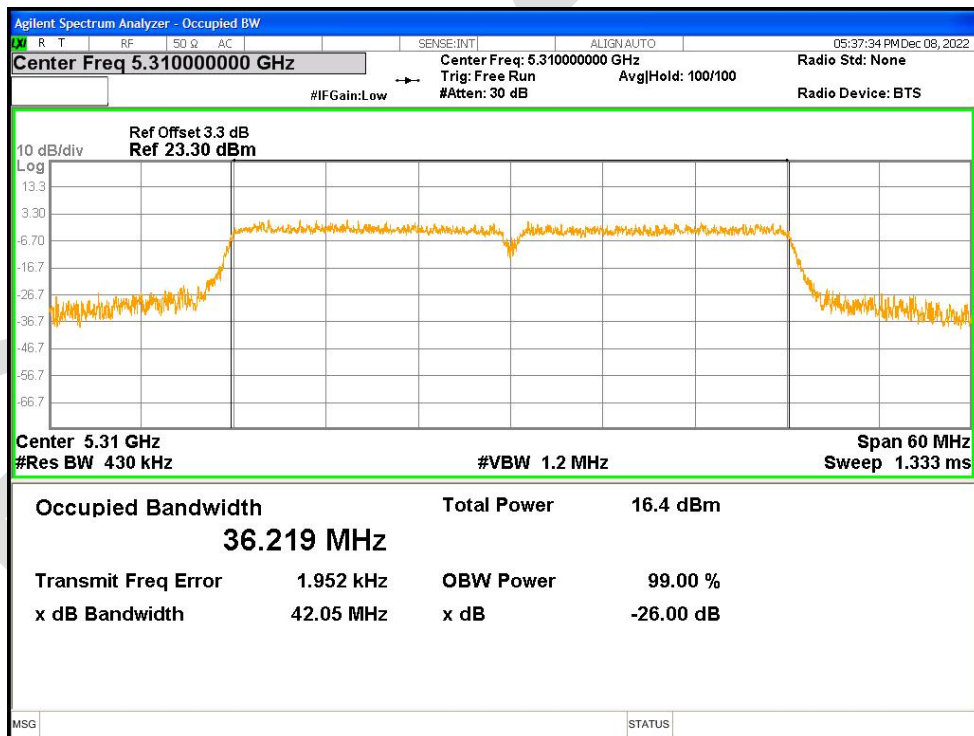


OBW NVNT n40 5510MHz Ant1

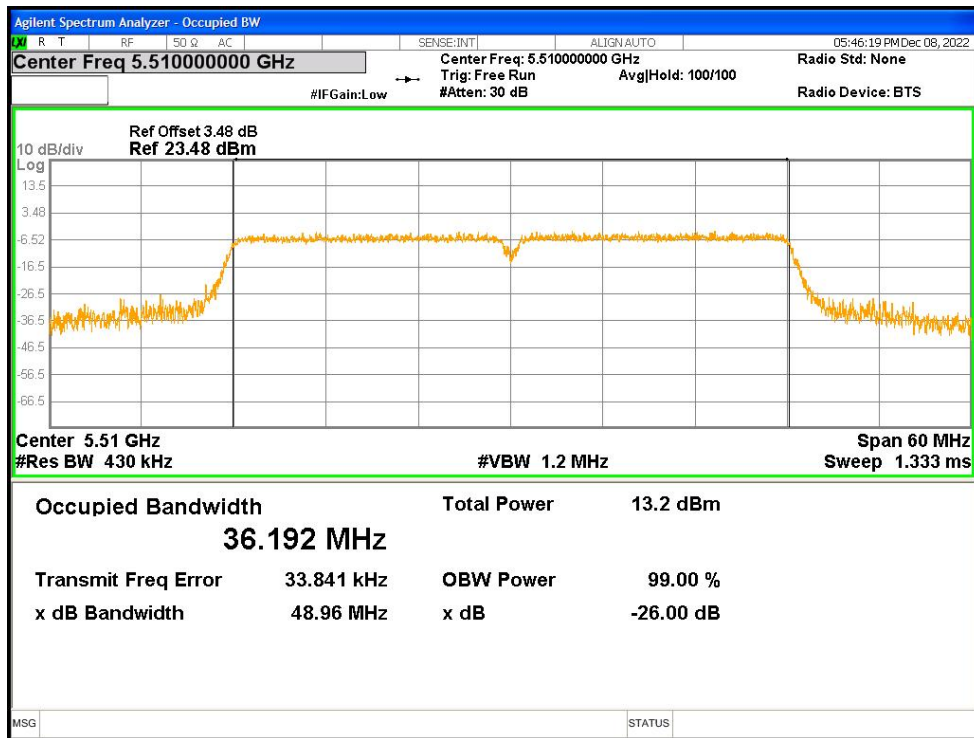


OBW NVNT n40 5510MHz Ant2

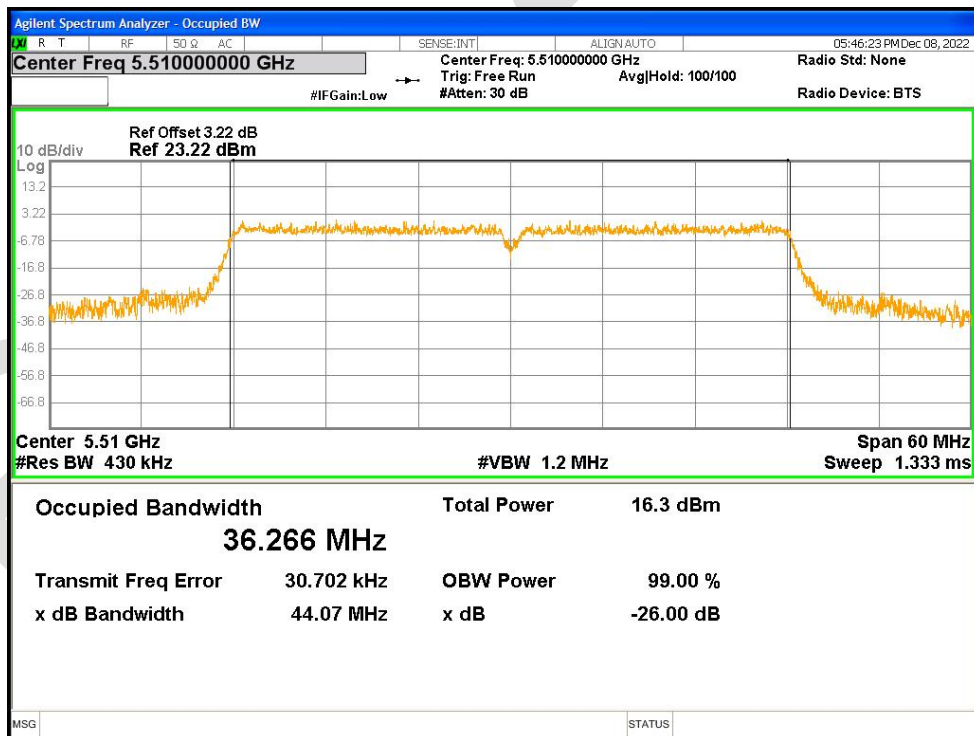


OBW NVNT n40 5590MHz Ant1

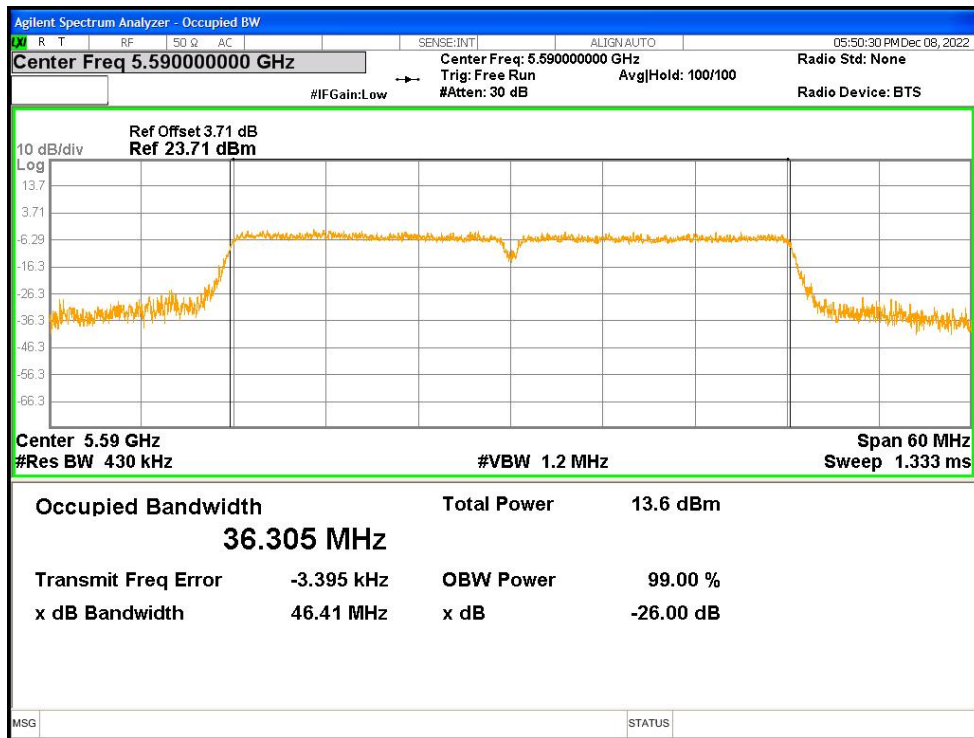


OBW NVNT n40 5590MHz Ant2

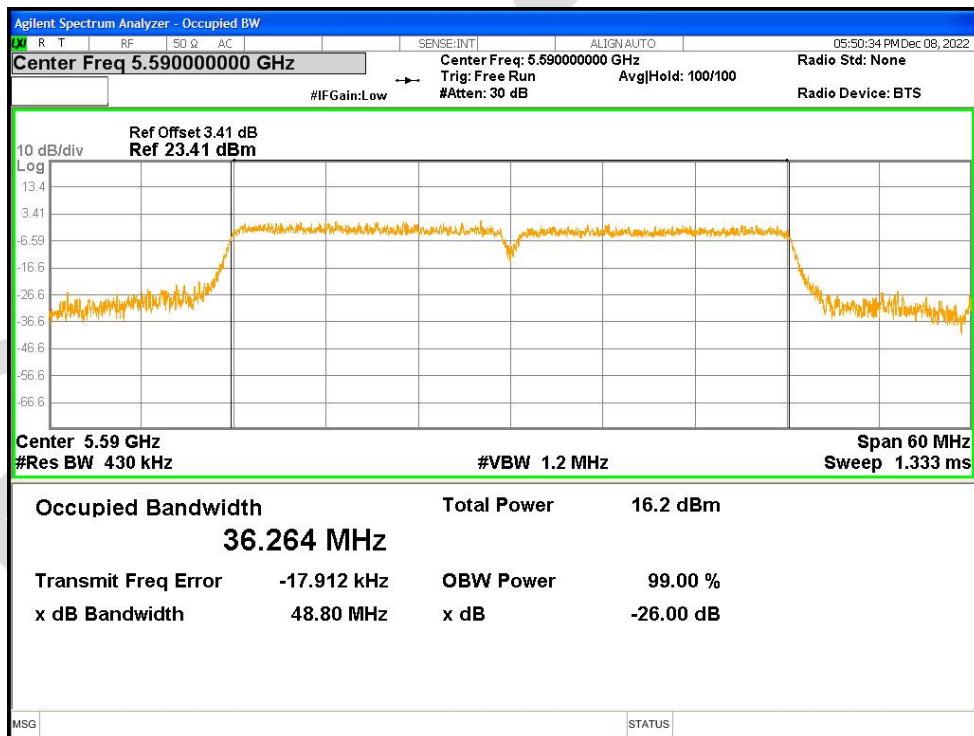


OBW NVNT n40 5670MHz Ant1

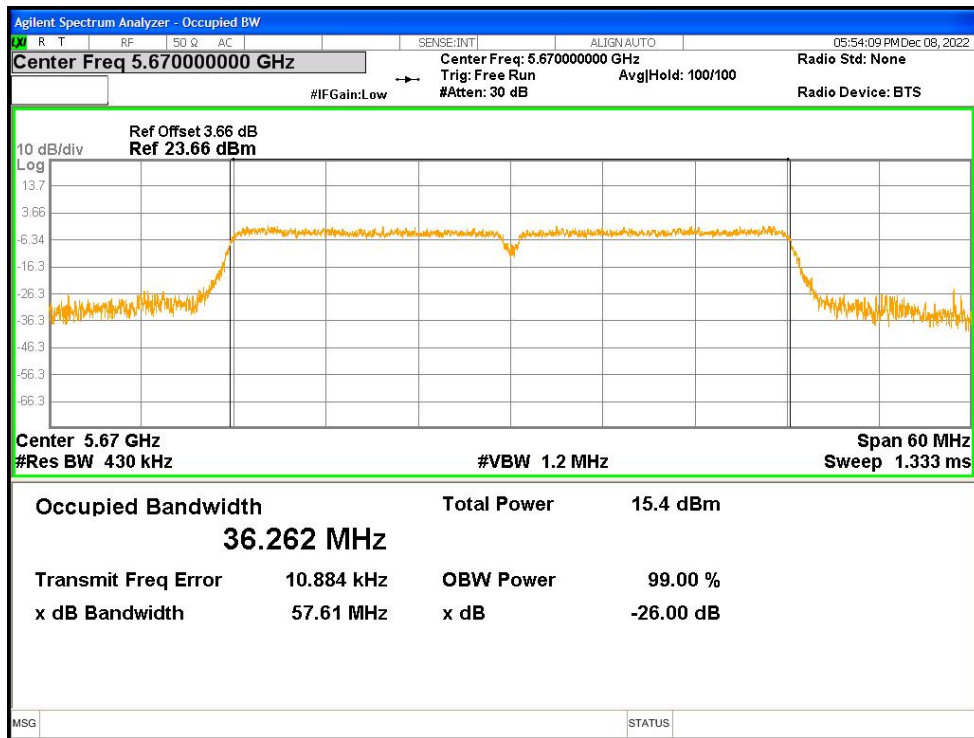


OBW NVNT n40 5670MHz Ant2

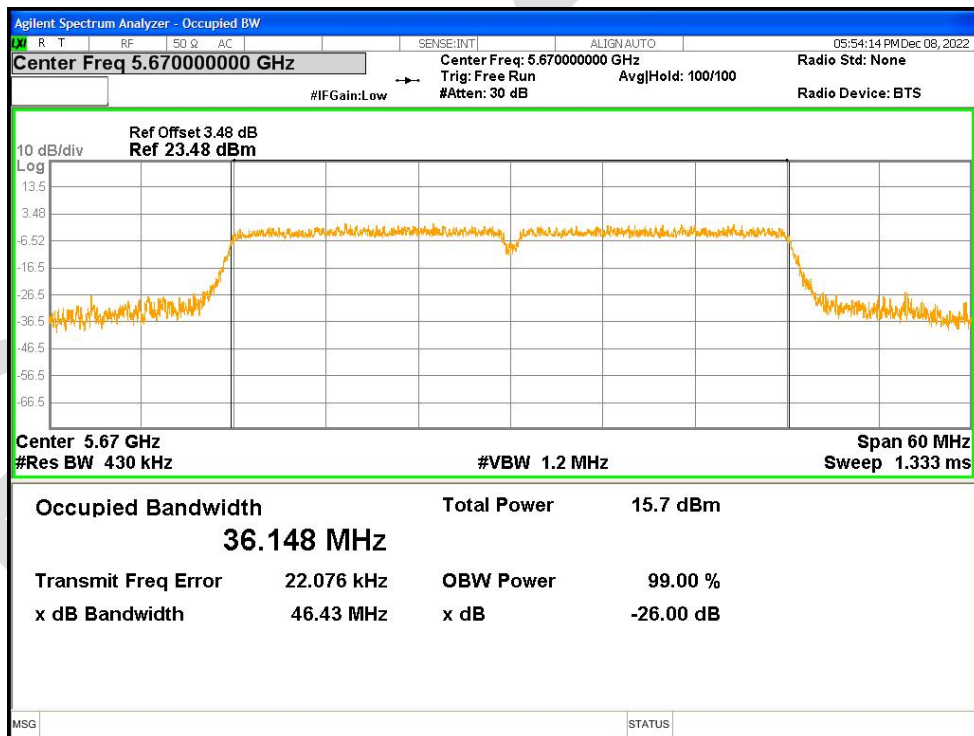


OBW NVNT n40 5755MHz Ant1

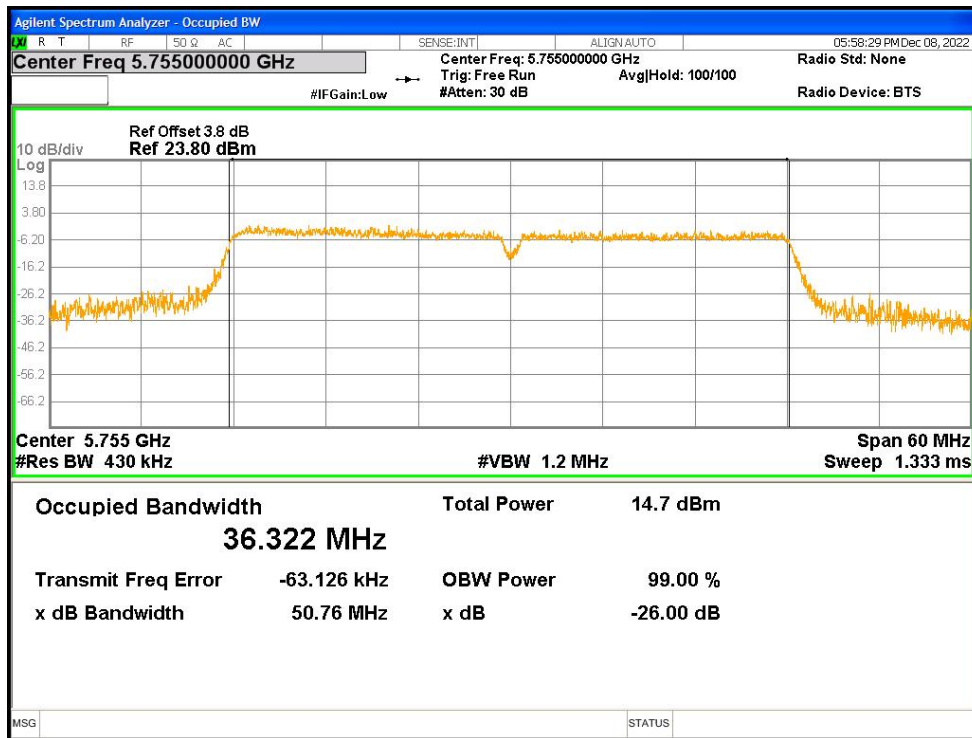


OBW NVNT n40 5755MHz Ant2

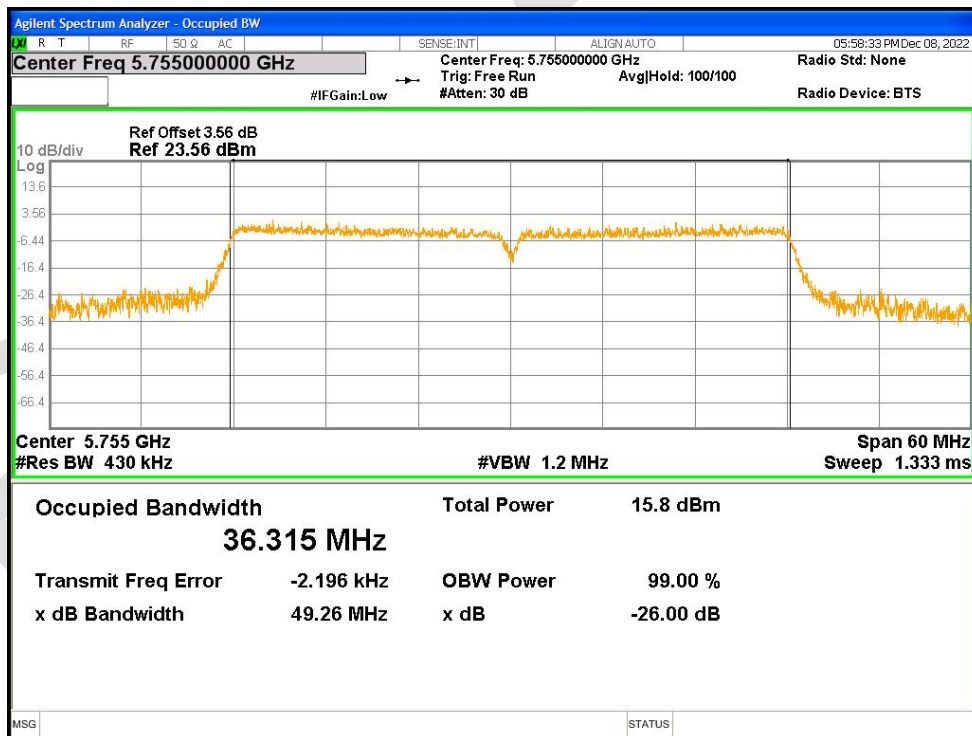

OBW NVNT n40 5795MHz Ant1

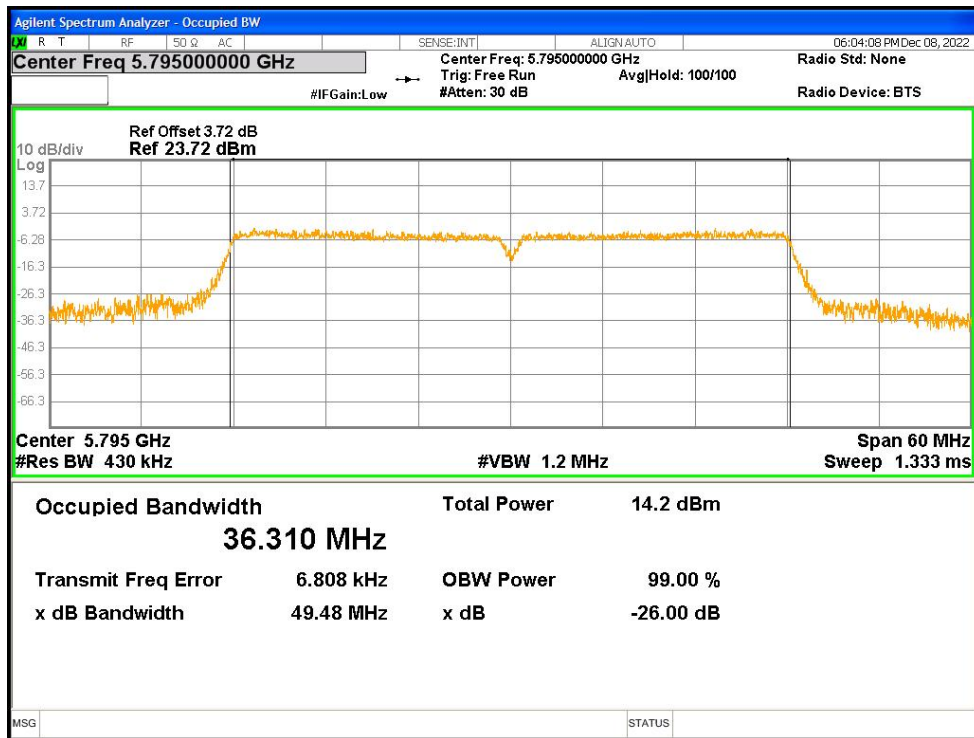

OBW NVNT n40 5795MHz Ant2

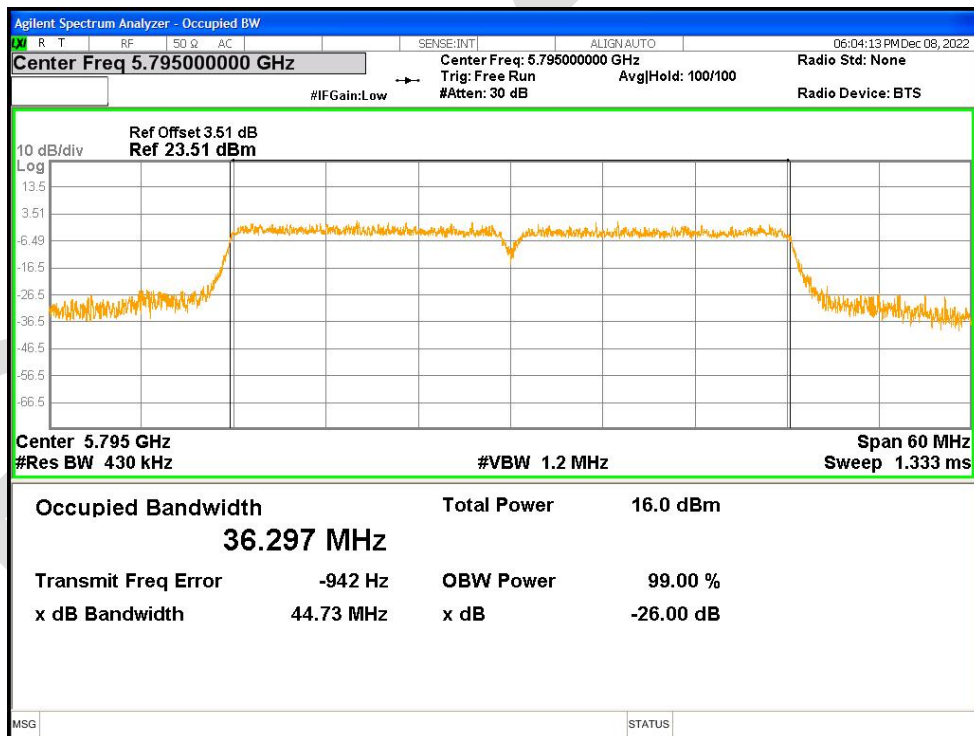

23.4 MAXIMUM POWER SPECTRAL DENSITY LEVEL

Condition	Mode	Frequency (MHz)	Antenna	Max PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	9.433	11	Pass
NVNT	a	5200	Ant1	9.817	11	Pass
NVNT	a	5240	Ant1	9.257	11	Pass
NVNT	a	5260	Ant1	8.626	11	Pass
NVNT	a	5280	Ant1	8.096	11	Pass
NVNT	a	5320	Ant1	8.041	11	Pass
NVNT	a	5500	Ant1	8.358	11	Pass
NVNT	a	5600	Ant1	8.752	11	Pass
NVNT	a	5700	Ant1	8.952	11	Pass
NVNT	a	5745	Ant1	5.204	30	Pass
NVNT	a	5785	Ant1	5.254	30	Pass
NVNT	a	5825	Ant1	5.542	30	Pass
NVNT	a	5180	Ant2	10.234	11	Pass
NVNT	a	5200	Ant2	8.636	11	Pass
NVNT	a	5240	Ant2	10.026	11	Pass
NVNT	a	5260	Ant2	8.562	11	Pass
NVNT	a	5280	Ant2	8.477	11	Pass
NVNT	a	5320	Ant2	8.452	11	Pass
NVNT	a	5500	Ant2	9.061	11	Pass
NVNT	a	5600	Ant2	9.229	11	Pass
NVNT	a	5700	Ant2	9.482	11	Pass
NVNT	a	5745	Ant2	5.956	30	Pass
NVNT	a	5785	Ant2	5.455	30	Pass
NVNT	a	5825	Ant2	5.161	30	Pass
NVNT	ac20	5180	Ant1	3.783	10.88	Pass
NVNT	ac20	5180	Ant2	6.682	10.88	Pass
NVNT	ac20	5180	Sum	8.48	10.88	Pass
NVNT	ac20	5200	Ant1	4.066	10.88	Pass
NVNT	ac20	5200	Ant2	6.823	10.88	Pass
NVNT	ac20	5200	Sum	8.67	10.88	Pass
NVNT	ac20	5240	Ant1	3.357	10.88	Pass
NVNT	ac20	5240	Ant2	6.734	10.88	Pass
NVNT	ac20	5240	Sum	8.376	10.88	Pass
NVNT	ac20	5260	Ant1	3.35	10.88	Pass
NVNT	ac20	5260	Ant2	7.312	10.88	Pass
NVNT	ac20	5260	Sum	8.778	10.88	Pass
NVNT	ac20	5280	Ant1	3.114	10.88	Pass
NVNT	ac20	5280	Ant2	8.425	10.88	Pass
NVNT	ac20	5280	Sum	9.546	10.88	Pass
NVNT	ac20	5320	Ant1	3.205	10.88	Pass
NVNT	ac20	5320	Ant2	7.71	10.88	Pass
NVNT	ac20	5320	Sum	9.027	10.88	Pass
NVNT	ac20	5500	Ant1	3.773	10.88	Pass

NVNT	ac20	5500	Ant2	7.525	10.88	Pass
NVNT	ac20	5500	Sum	9.052	10.88	Pass
NVNT	ac20	5600	Ant1	4.22	10.88	Pass
NVNT	ac20	5600	Ant2	7.155	10.88	Pass
NVNT	ac20	5600	Sum	8.941	10.88	Pass
NVNT	ac20	5700	Ant1	5.085	10.88	Pass
NVNT	ac20	5700	Ant2	6.146	10.88	Pass
NVNT	ac20	5700	Sum	8.658	10.88	Pass
NVNT	ac20	5745	Ant1	1.818	29.88	Pass
NVNT	ac20	5745	Ant2	3.568	29.88	Pass
NVNT	ac20	5745	Sum	5.791	29.88	Pass
NVNT	ac20	5785	Ant1	0.679	29.88	Pass
NVNT	ac20	5785	Ant2	4.024	29.88	Pass
NVNT	ac20	5785	Sum	5.676	29.88	Pass
NVNT	ac20	5825	Ant1	0.798	29.88	Pass
NVNT	ac20	5825	Ant2	3.835	29.88	Pass
NVNT	ac20	5825	Sum	5.587	29.88	Pass
NVNT	ac40	5190	Ant1	1.619	10.88	Pass
NVNT	ac40	5190	Ant2	4.805	10.88	Pass
NVNT	ac40	5190	Sum	6.508	10.88	Pass
NVNT	ac40	5230	Ant1	1.067	10.88	Pass
NVNT	ac40	5230	Ant2	5.294	10.88	Pass
NVNT	ac40	5230	Sum	6.686	10.88	Pass
NVNT	ac40	5270	Ant1	0.767	10.88	Pass
NVNT	ac40	5270	Ant2	5.077	10.88	Pass
NVNT	ac40	5270	Sum	6.446	10.88	Pass
NVNT	ac40	5310	Ant1	1.617	10.88	Pass
NVNT	ac40	5310	Ant2	5.516	10.88	Pass
NVNT	ac40	5310	Sum	7	10.88	Pass
NVNT	ac40	5510	Ant1	0.769	10.88	Pass
NVNT	ac40	5510	Ant2	5.092	10.88	Pass
NVNT	ac40	5510	Sum	6.458	10.88	Pass
NVNT	ac40	5590	Ant1	1.534	10.88	Pass
NVNT	ac40	5590	Ant2	5.103	10.88	Pass
NVNT	ac40	5590	Sum	6.686	10.88	Pass
NVNT	ac40	5670	Ant1	2.356	10.88	Pass
NVNT	ac40	5670	Ant2	3.005	10.88	Pass
NVNT	ac40	5670	Sum	5.703	10.88	Pass
NVNT	ac40	5755	Ant1	-1.834	29.88	Pass
NVNT	ac40	5755	Ant2	0.248	29.88	Pass
NVNT	ac40	5755	Sum	2.341	29.88	Pass
NVNT	ac40	5795	Ant1	-2.054	29.88	Pass
NVNT	ac40	5795	Ant2	1.437	29.88	Pass
NVNT	ac40	5795	Sum	3.044	29.88	Pass
NVNT	ac80	5210	Ant1	-1.814	10.88	Pass
NVNT	ac80	5210	Ant2	2.634	10.88	Pass
NVNT	ac80	5210	Sum	3.966	10.88	Pass

NVNT	ac80	5290	Ant1	-3.006	10.88	Pass
NVNT	ac80	5290	Ant2	2.214	10.88	Pass
NVNT	ac80	5290	Sum	3.355	10.88	Pass
NVNT	ac80	5530	Ant1	-2.689	10.88	Pass
NVNT	ac80	5530	Ant2	1.516	10.88	Pass
NVNT	ac80	5530	Sum	2.914	10.88	Pass
NVNT	ac80	5610	Ant1	-1.964	10.88	Pass
NVNT	ac80	5610	Ant2	1.565	10.88	Pass
NVNT	ac80	5610	Sum	3.16	10.88	Pass
NVNT	ac80	5690	Ant1	-0.885	10.88	Pass
NVNT	ac80	5690	Ant2	0.899	10.88	Pass
NVNT	ac80	5690	Sum	3.108	10.88	Pass
NVNT	ac80	5775	Ant1	-5.664	29.88	Pass
NVNT	ac80	5775	Ant2	-2.746	29.88	Pass
NVNT	ac80	5775	Sum	-0.954	29.88	Pass
NVNT	n20	5180	Ant1	3.85	10.88	Pass
NVNT	n20	5180	Ant2	7.565	10.88	Pass
NVNT	n20	5180	Sum	9.103	10.88	Pass
NVNT	n20	5200	Ant1	5.221	10.88	Pass
NVNT	n20	5200	Ant2	7.936	10.88	Pass
NVNT	n20	5200	Sum	9.798	10.88	Pass
NVNT	n20	5240	Ant1	4.468	10.88	Pass
NVNT	n20	5240	Ant2	8.526	10.88	Pass
NVNT	n20	5240	Sum	9.965	10.88	Pass
NVNT	n20	5260	Ant1	4.26	10.88	Pass
NVNT	n20	5260	Ant2	7.94	10.88	Pass
NVNT	n20	5260	Sum	9.489	10.88	Pass
NVNT	n20	5280	Ant1	3.286	10.88	Pass
NVNT	n20	5280	Ant2	7.655	10.88	Pass
NVNT	n20	5280	Sum	9.008	10.88	Pass
NVNT	n20	5320	Ant1	3.747	10.88	Pass
NVNT	n20	5320	Ant2	8.685	10.88	Pass
NVNT	n20	5320	Sum	9.893	10.88	Pass
NVNT	n20	5500	Ant1	4.371	10.88	Pass
NVNT	n20	5500	Ant2	8.425	10.88	Pass
NVNT	n20	5500	Sum	9.865	10.88	Pass
NVNT	n20	5600	Ant1	5.269	10.88	Pass
NVNT	n20	5600	Ant2	7.667	10.88	Pass
NVNT	n20	5600	Sum	9.642	10.88	Pass
NVNT	n20	5700	Ant1	6.508	10.88	Pass
NVNT	n20	5700	Ant2	7.292	10.88	Pass
NVNT	n20	5700	Sum	9.928	10.88	Pass
NVNT	n20	5745	Ant1	3.055	29.88	Pass
NVNT	n20	5745	Ant2	5.351	29.88	Pass
NVNT	n20	5745	Sum	7.363	29.88	Pass
NVNT	n20	5785	Ant1	1.757	29.88	Pass
NVNT	n20	5785	Ant2	4.323	29.88	Pass

NVNT	n20	5785	Sum	6.237	29.88	Pass
NVNT	n20	5825	Ant1	1.567	29.88	Pass
NVNT	n20	5825	Ant2	4.39	29.88	Pass
NVNT	n20	5825	Sum	6.214	29.88	Pass
NVNT	n40	5190	Ant1	0.648	10.88	Pass
NVNT	n40	5190	Ant2	4.842	10.88	Pass
NVNT	n40	5190	Sum	6.243	10.88	Pass
NVNT	n40	5230	Ant1	0.824	10.88	Pass
NVNT	n40	5230	Ant2	5.119	10.88	Pass
NVNT	n40	5230	Sum	6.492	10.88	Pass
NVNT	n40	5270	Ant1	0.536	10.88	Pass
NVNT	n40	5270	Ant2	4.745	10.88	Pass
NVNT	n40	5270	Sum	6.142	10.88	Pass
NVNT	n40	5310	Ant1	1.377	10.88	Pass
NVNT	n40	5310	Ant2	5.687	10.88	Pass
NVNT	n40	5310	Sum	7.056	10.88	Pass
NVNT	n40	5510	Ant1	0.927	10.88	Pass
NVNT	n40	5510	Ant2	4.722	10.88	Pass
NVNT	n40	5510	Sum	6.237	10.88	Pass
NVNT	n40	5590	Ant1	1.853	10.88	Pass
NVNT	n40	5590	Ant2	6.138	10.88	Pass
NVNT	n40	5590	Sum	7.514	10.88	Pass
NVNT	n40	5670	Ant1	3.205	10.88	Pass
NVNT	n40	5670	Ant2	3.972	10.88	Pass
NVNT	n40	5670	Sum	6.616	10.88	Pass
NVNT	n40	5755	Ant1	0.399	29.88	Pass
NVNT	n40	5755	Ant2	2.009	29.88	Pass
NVNT	n40	5755	Sum	4.288	29.88	Pass
NVNT	n40	5795	Ant1	-0.92	29.88	Pass
NVNT	n40	5795	Ant2	1.549	29.88	Pass
NVNT	n40	5795	Sum	3.498	29.88	Pass