

-20C 120V	11AC20SISO	5785	Ant1	5785	0	0	25	Pass
-10C 120V	11AC20SISO	5785	Ant1	5785	0	0	25	Pass
0C 120V	11AC20SISO	5785	Ant1	5785.02	20000	3.46	25	Pass
10C 120V	11AC20SISO	5785	Ant1	5785	0	0	25	Pass
30C 120V	11AC20SISO	5785	Ant1	5785	0	0	25	Pass
40C 120V	11AC20SISO	5785	Ant1	5785	0	0	25	Pass
50C 120V	11AC20SISO	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 102V	11AC20SISO	5825	Ant1	5825	0	0	25	Pass
20C 120V	11AC20SISO	5825	Ant1	5825	0	0	25	Pass
20C 138V	11AC20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	11AC20SISO	5825	Ant1	5825	0	0	25	Pass
-10C 120V	11AC20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	11AC20SISO	5825	Ant1	5825.04	40000	6.87	25	Pass
10C 120V	11AC20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 120V	11AC20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	11AC20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	11AC20SISO	5825	Ant1	5825	0	0	25	Pass
20C 102V	11AC20SISO	5180	Ant2	5180	0	0	25	Pass
20C 120V	11AC20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 138V	11AC20SISO	5180	Ant2	5180	0	0	25	Pass
-20C 120V	11AC20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
-10C 120V	11AC20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
0C 120V	11AC20SISO	5180	Ant2	5180	0	0	25	Pass
10C 120V	11AC20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
30C 120V	11AC20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
40C 120V	11AC20SISO	5180	Ant2	5180	0	0	25	Pass
50C 120V	11AC20SISO	5180	Ant2	5180	0	0	25	Pass
20C 102V	11AC20SISO	5200	Ant2	5200	0	0	25	Pass
20C 120V	11AC20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
20C 138V	11AC20SISO	5200	Ant2	5200.04	40000	7.69	25	Pass
-20C 120V	11AC20SISO	5200	Ant2	5200	0	0	25	Pass
-10C 120V	11AC20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
0C 120V	11AC20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
10C 120V	11AC20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
30C 120V	11AC20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
40C 120V	11AC20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
50C 120V	11AC20SISO	5200	Ant2	5200	0	0	25	Pass
20C 102V	11AC20SISO	5240	Ant2	5240.04	40000	7.63	25	Pass
20C 120V	11AC20SISO	5240	Ant2	5240.04	40000	7.63	25	Pass
20C 138V	11AC20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
-20C 120V	11AC20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
-10C 120V	11AC20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass

0C 120V	11AC20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
10C 120V	11AC20SISO	5240	Ant2	5240.04	40000	7.63	25	Pass
30C 120V	11AC20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
40C 120V	11AC20SISO	5240	Ant2	5240.04	40000	7.63	25	Pass
50C 120V	11AC20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 102V	11AC20SISO	5745	Ant2	5745	0	0	25	Pass
20C 120V	11AC20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 138V	11AC20SISO	5745	Ant2	5745.06	60000	10.44	25	Pass
-20C 120V	11AC20SISO	5745	Ant2	5745	0	0	25	Pass
-10C 120V	11AC20SISO	5745	Ant2	5745.04	40000	6.96	25	Pass
0C 120V	11AC20SISO	5745	Ant2	5745.04	40000	6.96	25	Pass
10C 120V	11AC20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
30C 120V	11AC20SISO	5745	Ant2	5745	0	0	25	Pass
40C 120V	11AC20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
50C 120V	11AC20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
NVNT	11AC20SISO	5785	Ant2	5785	0	0	25	Pass
20C 102V	11AC20SISO	5825	Ant2	5825	0	0	25	Pass
20C 120V	11AC20SISO	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 138V	11AC20SISO	5825	Ant2	5825	0	0	25	Pass
-20C 120V	11AC20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
-10C 120V	11AC20SISO	5825	Ant2	5825.04	40000	6.87	25	Pass
0C 120V	11AC20SISO	5825	Ant2	5825	0	0	25	Pass
10C 120V	11AC20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
30C 120V	11AC20SISO	5825	Ant2	5825.04	40000	6.87	25	Pass
40C 120V	11AC20SISO	5825	Ant2	5825.06	60000	10.3	25	Pass
50C 120V	11AC20SISO	5825	Ant2	5825.04	40000	6.87	25	Pass
20C 102V	11AC40SISO	5190	Ant1	5190	0	0	25	Pass
20C 120V	11AC40SISO	5190	Ant1	5190	0	0	25	Pass
20C 138V	11AC40SISO	5190	Ant1	5190	0	0	25	Pass
-20C 120V	11AC40SISO	5190	Ant1	5190	0	0	25	Pass
-10C 120V	11AC40SISO	5190	Ant1	5190	0	0	25	Pass
0C 120V	11AC40SISO	5190	Ant1	5190	0	0	25	Pass
10C 120V	11AC40SISO	5190	Ant1	5189.96	-40000	-7.71	25	Pass
30C 120V	11AC40SISO	5190	Ant1	5190	0	0	25	Pass
40C 120V	11AC40SISO	5190	Ant1	5190	0	0	25	Pass
50C 120V	11AC40SISO	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 102V	11AC40SISO	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 120V	11AC40SISO	5230	Ant1	5230	0	0	25	Pass
20C 138V	11AC40SISO	5230	Ant1	5230	0	0	25	Pass
-20C 120V	11AC40SISO	5230	Ant1	5230	0	0	25	Pass
-10C 120V	11AC40SISO	5230	Ant1	5230	0	0	25	Pass
0C 120V	11AC40SISO	5230	Ant1	5230	0	0	25	Pass

10C 120V	11AC40SISO	5230	Ant1	5230	0	0	25	Pass
30C 120V	11AC40SISO	5230	Ant1	5230	0	0	25	Pass
40C 120V	11AC40SISO	5230	Ant1	5230	0	0	25	Pass
50C 120V	11AC40SISO	5230	Ant1	5230	0	0	25	Pass
20C 102V	11AC40SISO	5755	Ant1	5755	0	0	25	Pass
20C 120V	11AC40SISO	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 138V	11AC40SISO	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-20C 120V	11AC40SISO	5755	Ant1	5755	0	0	25	Pass
-10C 120V	11AC40SISO	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	11AC40SISO	5755	Ant1	5755	0	0	25	Pass
10C 120V	11AC40SISO	5755	Ant1	5754.96	-40000	-6.95	25	Pass
30C 120V	11AC40SISO	5755	Ant1	5755	0	0	25	Pass
40C 120V	11AC40SISO	5755	Ant1	5755	0	0	25	Pass
50C 120V	11AC40SISO	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 102V	11AC40SISO	5795	Ant1	5795	0	0	25	Pass
20C 120V	11AC40SISO	5795	Ant1	5795	0	0	25	Pass
20C 138V	11AC40SISO	5795	Ant1	5795	0	0	25	Pass
-20C 120V	11AC40SISO	5795	Ant1	5795	0	0	25	Pass
-10C 120V	11AC40SISO	5795	Ant1	5795	0	0	25	Pass
0C 120V	11AC40SISO	5795	Ant1	5795.04	40000	6.9	25	Pass
10C 120V	11AC40SISO	5795	Ant1	5795	0	0	25	Pass
30C 120V	11AC40SISO	5795	Ant1	5794.96	-40000	-6.9	25	Pass
40C 120V	11AC40SISO	5795	Ant1	5795	0	0	25	Pass
50C 120V	11AC40SISO	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 102V	11AC40SISO	5190	Ant2	5190	0	0	25	Pass
20C 120V	11AC40SISO	5190	Ant2	5190	0	0	25	Pass
20C 138V	11AC40SISO	5190	Ant2	5190	0	0	25	Pass
-20C 120V	11AC40SISO	5190	Ant2	5190	0	0	25	Pass
-10C 120V	11AC40SISO	5190	Ant2	5190	0	0	25	Pass
0C 120V	11AC40SISO	5190	Ant2	5190	0	0	25	Pass
10C 120V	11AC40SISO	5190	Ant2	5190	0	0	25	Pass
30C 120V	11AC40SISO	5190	Ant2	5190.04	40000	7.71	25	Pass
40C 120V	11AC40SISO	5190	Ant2	5190	0	0	25	Pass
50C 120V	11AC40SISO	5190	Ant2	5190	0	0	25	Pass
20C 102V	11AC40SISO	5230	Ant2	5230	0	0	25	Pass
20C 120V	11AC40SISO	5230	Ant2	5230	0	0	25	Pass
20C 138V	11AC40SISO	5230	Ant2	5230	0	0	25	Pass
-20C 120V	11AC40SISO	5230	Ant2	5230	0	0	25	Pass
-10C 120V	11AC40SISO	5230	Ant2	5230	0	0	25	Pass
0C 120V	11AC40SISO	5230	Ant2	5229.96	-40000	-7.65	25	Pass
10C 120V	11AC40SISO	5230	Ant2	5230	0	0	25	Pass
30C 120V	11AC40SISO	5230	Ant2	5230	0	0	25	Pass

40C 120V	11AC40SISO	5230	Ant2	5230	0	0	25	Pass
50C 120V	11AC40SISO	5230	Ant2	5230	0	0	25	Pass
20C 102V	11AC40SISO	5755	Ant2	5755	0	0	25	Pass
20C 120V	11AC40SISO	5755	Ant2	5755	0	0	25	Pass
20C 138V	11AC40SISO	5755	Ant2	5755.04	40000	6.95	25	Pass
-20C 120V	11AC40SISO	5755	Ant2	5755	0	0	25	Pass
-10C 120V	11AC40SISO	5755	Ant2	5755.04	40000	6.95	25	Pass
0C 120V	11AC40SISO	5755	Ant2	5755	0	0	25	Pass
10C 120V	11AC40SISO	5755	Ant2	5755	0	0	25	Pass
30C 120V	11AC40SISO	5755	Ant2	5755.04	40000	6.95	25	Pass
40C 120V	11AC40SISO	5755	Ant2	5755	0	0	25	Pass
50C 120V	11AC40SISO	5755	Ant2	5755	0	0	25	Pass
20C 102V	11AC40SISO	5795	Ant2	5795	0	0	25	Pass
20C 120V	11AC40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
20C 138V	11AC40SISO	5795	Ant2	5795	0	0	25	Pass
-20C 120V	11AC40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
-10C 120V	11AC40SISO	5795	Ant2	5795	0	0	25	Pass
0C 120V	11AC40SISO	5795	Ant2	5795	0	0	25	Pass
10C 120V	11AC40SISO	5795	Ant2	5795	0	0	25	Pass
30C 120V	11AC40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
40C 120V	11AC40SISO	5795	Ant2	5795	0	0	25	Pass
50C 120V	11AC40SISO	5795	Ant2	5795	0	0	25	Pass
20C 102V	11AC80SISO	5210	Ant1	5210	0	0	25	Pass
20C 120V	11AC80SISO	5210	Ant1	5210	0	0	25	Pass
20C 138V	11AC80SISO	5210	Ant1	5210	0	0	25	Pass
-20C 120V	11AC80SISO	5210	Ant1	5210	0	0	25	Pass
-10C 120V	11AC80SISO	5210	Ant1	5209.92	-80000	-15.36	25	Pass
0C 120V	11AC80SISO	5210	Ant1	5210	0	0	25	Pass
10C 120V	11AC80SISO	5210	Ant1	5210	0	0	25	Pass
30C 120V	11AC80SISO	5210	Ant1	5210	0	0	25	Pass
40C 120V	11AC80SISO	5210	Ant1	5210.08	80000	15.36	25	Pass
50C 120V	11AC80SISO	5210	Ant1	5210	0	0	25	Pass
20C 102V	11AC80SISO	5775	Ant1	5775	0	0	25	Pass
20C 120V	11AC80SISO	5775	Ant1	5775	0	0	25	Pass
20C 138V	11AC80SISO	5775	Ant1	5775	0	0	25	Pass
-20C 120V	11AC80SISO	5775	Ant1	5775	0	0	25	Pass
-10C 120V	11AC80SISO	5775	Ant1	5775	0	0	25	Pass
0C 120V	11AC80SISO	5775	Ant1	5775	0	0	25	Pass
10C 120V	11AC80SISO	5775	Ant1	5775	0	0	25	Pass
30C 120V	11AC80SISO	5775	Ant1	5775	0	0	25	Pass
40C 120V	11AC80SISO	5775	Ant1	5775	0	0	25	Pass
50C 120V	11AC80SISO	5775	Ant1	5775	0	0	25	Pass

20C 102V	11AC80SISO	5210	Ant2	5210	0	0	25	Pass
20C 120V	11AC80SISO	5210	Ant2	5210	0	0	25	Pass
20C 138V	11AC80SISO	5210	Ant2	5210	0	0	25	Pass
-20C 120V	11AC80SISO	5210	Ant2	5210	0	0	25	Pass
-10C 120V	11AC80SISO	5210	Ant2	5210	0	0	25	Pass
0C 120V	11AC80SISO	5210	Ant2	5210	0	0	25	Pass
10C 120V	11AC80SISO	5210	Ant2	5210	0	0	25	Pass
30C 120V	11AC80SISO	5210	Ant2	5209.92	-80000	-15.36	25	Pass
40C 120V	11AC80SISO	5210	Ant2	5210	0	0	25	Pass
50C 120V	11AC80SISO	5210	Ant2	5210	0	0	25	Pass
20C 102V	11AC80SISO	5775	Ant2	5775	0	0	25	Pass
20C 120V	11AC80SISO	5775	Ant2	5775	0	0	25	Pass
20C 138V	11AC80SISO	5775	Ant2	5775	0	0	25	Pass
-20C 120V	11AC80SISO	5775	Ant2	5775	0	0	25	Pass
-10C 120V	11AC80SISO	5775	Ant2	5775	0	0	25	Pass
0C 120V	11AC80SISO	5775	Ant2	5775	0	0	25	Pass
10C 120V	11AC80SISO	5775	Ant2	5775	0	0	25	Pass
30C 120V	11AC80SISO	5775	Ant2	5775	0	0	25	Pass
40C 120V	11AC80SISO	5775	Ant2	5775	0	0	25	Pass
50C 120V	11AC80SISO	5775	Ant2	5775	0	0	25	Pass
20C 102V	11AX20SISO	5180	Ant1	5180	0	0	25	Pass
20C 120V	11AX20SISO	5180	Ant1	5180	0	0	25	Pass
20C 138V	11AX20SISO	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 120V	11AX20SISO	5180	Ant1	5180	0	0	25	Pass
-10C 120V	11AX20SISO	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 120V	11AX20SISO	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 120V	11AX20SISO	5180	Ant1	5180	0	0	25	Pass
30C 120V	11AX20SISO	5180	Ant1	5180	0	0	25	Pass
40C 120V	11AX20SISO	5180	Ant1	5180	0	0	25	Pass
50C 120V	11AX20SISO	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 102V	11AX20SISO	5200	Ant1	5200	0	0	25	Pass
20C 120V	11AX20SISO	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 138V	11AX20SISO	5200	Ant1	5200	0	0	25	Pass
-20C 120V	11AX20SISO	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-10C 120V	11AX20SISO	5200	Ant1	5200	0	0	25	Pass
0C 120V	11AX20SISO	5200	Ant1	5199.98	-20000	-3.85	25	Pass
10C 120V	11AX20SISO	5200	Ant1	5199.98	-20000	-3.85	25	Pass
30C 120V	11AX20SISO	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 120V	11AX20SISO	5200	Ant1	5199.96	-40000	-7.69	25	Pass
50C 120V	11AX20SISO	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 102V	11AX20SISO	5240	Ant1	5240	0	0	25	Pass
20C 120V	11AX20SISO	5240	Ant1	5240	0	0	25	Pass

20C 138V	11AX20SISO	5240	Ant1	5240	0	0	25	Pass
-20C 120V	11AX20SISO	5240	Ant1	5240.02	20000	3.82	25	Pass
-10C 120V	11AX20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	11AX20SISO	5240	Ant1	5240	0	0	25	Pass
10C 120V	11AX20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
30C 120V	11AX20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 120V	11AX20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
50C 120V	11AX20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	11AX20SISO	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 120V	11AX20SISO	5745	Ant1	5745	0	0	25	Pass
20C 138V	11AX20SISO	5745	Ant1	5745	0	0	25	Pass
-20C 120V	11AX20SISO	5745	Ant1	5745	0	0	25	Pass
-10C 120V	11AX20SISO	5745	Ant1	5745	0	0	25	Pass
0C 120V	11AX20SISO	5745	Ant1	5745	0	0	25	Pass
10C 120V	11AX20SISO	5745	Ant1	5745	0	0	25	Pass
30C 120V	11AX20SISO	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	11AX20SISO	5745	Ant1	5745	0	0	25	Pass
50C 120V	11AX20SISO	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 102V	11AX20SISO	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 120V	11AX20SISO	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 138V	11AX20SISO	5785	Ant1	5784.96	-40000	-6.91	25	Pass
-20C 120V	11AX20SISO	5785	Ant1	5785	0	0	25	Pass
-10C 120V	11AX20SISO	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 120V	11AX20SISO	5785	Ant1	5784.98	-20000	-3.46	25	Pass
10C 120V	11AX20SISO	5785	Ant1	5784.98	-20000	-3.46	25	Pass
30C 120V	11AX20SISO	5785	Ant1	5785	0	0	25	Pass
40C 120V	11AX20SISO	5785	Ant1	5785	0	0	25	Pass
50C 120V	11AX20SISO	5785	Ant1	5785	0	0	25	Pass
20C 102V	11AX20SISO	5825	Ant1	5824.96	-40000	-6.87	25	Pass
20C 120V	11AX20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	11AX20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	11AX20SISO	5825	Ant1	5825	0	0	25	Pass
-10C 120V	11AX20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	11AX20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	11AX20SISO	5825	Ant1	5825	0	0	25	Pass
30C 120V	11AX20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	11AX20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	11AX20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	11AX20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 120V	11AX20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 138V	11AX20SISO	5180	Ant2	5180.04	40000	7.72	25	Pass
-20C 120V	11AX20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass

-10C 120V	11AX20SISO	5180	Ant2	5180.04	40000	7.72	25	Pass
0C 120V	11AX20SISO	5180	Ant2	5180.04	40000	7.72	25	Pass
10C 120V	11AX20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
30C 120V	11AX20SISO	5180	Ant2	5180	0	0	25	Pass
40C 120V	11AX20SISO	5180	Ant2	5180	0	0	25	Pass
50C 120V	11AX20SISO	5180	Ant2	5180	0	0	25	Pass
20C 102V	11AX20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
20C 120V	11AX20SISO	5200	Ant2	5200	0	0	25	Pass
20C 138V	11AX20SISO	5200	Ant2	5200.04	40000	7.69	25	Pass
-20C 120V	11AX20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
-10C 120V	11AX20SISO	5200	Ant2	5200	0	0	25	Pass
0C 120V	11AX20SISO	5200	Ant2	5200	0	0	25	Pass
10C 120V	11AX20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
30C 120V	11AX20SISO	5200	Ant2	5200	0	0	25	Pass
40C 120V	11AX20SISO	5200	Ant2	5200	0	0	25	Pass
50C 120V	11AX20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
20C 102V	11AX20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 120V	11AX20SISO	5240	Ant2	5240	0	0	25	Pass
20C 138V	11AX20SISO	5240	Ant2	5240	0	0	25	Pass
-20C 120V	11AX20SISO	5240	Ant2	5240	0	0	25	Pass
-10C 120V	11AX20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
0C 120V	11AX20SISO	5240	Ant2	5240	0	0	25	Pass
10C 120V	11AX20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
30C 120V	11AX20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
40C 120V	11AX20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
50C 120V	11AX20SISO	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 102V	11AX20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 120V	11AX20SISO	5745	Ant2	5745.04	40000	6.96	25	Pass
20C 138V	11AX20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
-20C 120V	11AX20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
-10C 120V	11AX20SISO	5745	Ant2	5744.98	-20000	-3.48	25	Pass
0C 120V	11AX20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
10C 120V	11AX20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
30C 120V	11AX20SISO	5745	Ant2	5745.04	40000	6.96	25	Pass
40C 120V	11AX20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
50C 120V	11AX20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 102V	11AX20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
20C 120V	11AX20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
20C 138V	11AX20SISO	5785	Ant2	5785.04	40000	6.91	25	Pass
-20C 120V	11AX20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
-10C 120V	11AX20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
0C 120V	11AX20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass

10C 120V	11AX20SISO	5785	Ant2	5785	0	0	25	Pass
30C 120V	11AX20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
40C 120V	11AX20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
50C 120V	11AX20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
20C 102V	11AX20SISO	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 120V	11AX20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 138V	11AX20SISO	5825	Ant2	5825	0	0	25	Pass
-20C 120V	11AX20SISO	5825	Ant2	5825.06	60000	10.3	25	Pass
-10C 120V	11AX20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
0C 120V	11AX20SISO	5825	Ant2	5825	0	0	25	Pass
10C 120V	11AX20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
30C 120V	11AX20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
40C 120V	11AX20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
50C 120V	11AX20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 102V	11AX40SISO	5190	Ant1	5190	0	0	25	Pass
20C 120V	11AX40SISO	5190	Ant1	5190	0	0	25	Pass
20C 138V	11AX40SISO	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-20C 120V	11AX40SISO	5190	Ant1	5190.04	40000	7.71	25	Pass
-10C 120V	11AX40SISO	5190	Ant1	5190	0	0	25	Pass
0C 120V	11AX40SISO	5190	Ant1	5190	0	0	25	Pass
10C 120V	11AX40SISO	5190	Ant1	5190	0	0	25	Pass
30C 120V	11AX40SISO	5190	Ant1	5190	0	0	25	Pass
40C 120V	11AX40SISO	5190	Ant1	5190	0	0	25	Pass
50C 120V	11AX40SISO	5190	Ant1	5190	0	0	25	Pass
20C 102V	11AX40SISO	5230	Ant1	5229.92	-80000	-15.3	25	Pass
20C 120V	11AX40SISO	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 138V	11AX40SISO	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-20C 120V	11AX40SISO	5230	Ant1	5230	0	0	25	Pass
-10C 120V	11AX40SISO	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 120V	11AX40SISO	5230	Ant1	5230	0	0	25	Pass
10C 120V	11AX40SISO	5230	Ant1	5230	0	0	25	Pass
30C 120V	11AX40SISO	5230	Ant1	5230	0	0	25	Pass
40C 120V	11AX40SISO	5230	Ant1	5230	0	0	25	Pass
50C 120V	11AX40SISO	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 102V	11AX40SISO	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	11AX40SISO	5755	Ant1	5755	0	0	25	Pass
20C 138V	11AX40SISO	5755	Ant1	5755	0	0	25	Pass
-20C 120V	11AX40SISO	5755	Ant1	5755	0	0	25	Pass
-10C 120V	11AX40SISO	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	11AX40SISO	5755	Ant1	5755	0	0	25	Pass
10C 120V	11AX40SISO	5755	Ant1	5755	0	0	25	Pass
30C 120V	11AX40SISO	5755	Ant1	5755	0	0	25	Pass

40C 120V	11AX40SISO	5755	Ant1	5754.96	-40000	-6.95	25	Pass
50C 120V	11AX40SISO	5755	Ant1	5755	0	0	25	Pass
20C 102V	11AX40SISO	5795	Ant1	5795	0	0	25	Pass
20C 120V	11AX40SISO	5795	Ant1	5794.96	-40000	-6.9	25	Pass
20C 138V	11AX40SISO	5795	Ant1	5795	0	0	25	Pass
-20C 120V	11AX40SISO	5795	Ant1	5795	0	0	25	Pass
-10C 120V	11AX40SISO	5795	Ant1	5795	0	0	25	Pass
0C 120V	11AX40SISO	5795	Ant1	5795	0	0	25	Pass
10C 120V	11AX40SISO	5795	Ant1	5795	0	0	25	Pass
30C 120V	11AX40SISO	5795	Ant1	5795	0	0	25	Pass
40C 120V	11AX40SISO	5795	Ant1	5794.96	-40000	-6.9	25	Pass
50C 120V	11AX40SISO	5795	Ant1	5795	0	0	25	Pass
20C 102V	11AX40SISO	5190	Ant2	5190.04	40000	7.71	25	Pass
20C 120V	11AX40SISO	5190	Ant2	5190	0	0	25	Pass
20C 138V	11AX40SISO	5190	Ant2	5190	0	0	25	Pass
-20C 120V	11AX40SISO	5190	Ant2	5190	0	0	25	Pass
-10C 120V	11AX40SISO	5190	Ant2	5190	0	0	25	Pass
0C 120V	11AX40SISO	5190	Ant2	5190	0	0	25	Pass
10C 120V	11AX40SISO	5190	Ant2	5190	0	0	25	Pass
30C 120V	11AX40SISO	5190	Ant2	5190	0	0	25	Pass
40C 120V	11AX40SISO	5190	Ant2	5190.04	40000	7.71	25	Pass
50C 120V	11AX40SISO	5190	Ant2	5190.04	40000	7.71	25	Pass
20C 102V	11AX40SISO	5230	Ant2	5230.04	40000	7.65	25	Pass
20C 120V	11AX40SISO	5230	Ant2	5230	0	0	25	Pass
20C 138V	11AX40SISO	5230	Ant2	5230	0	0	25	Pass
-20C 120V	11AX40SISO	5230	Ant2	5230	0	0	25	Pass
-10C 120V	11AX40SISO	5230	Ant2	5230	0	0	25	Pass
0C 120V	11AX40SISO	5230	Ant2	5230	0	0	25	Pass
10C 120V	11AX40SISO	5230	Ant2	5230	0	0	25	Pass
30C 120V	11AX40SISO	5230	Ant2	5230	0	0	25	Pass
40C 120V	11AX40SISO	5230	Ant2	5230	0	0	25	Pass
50C 120V	11AX40SISO	5230	Ant2	5230	0	0	25	Pass
20C 102V	11AX40SISO	5755	Ant2	5755	0	0	25	Pass
20C 120V	11AX40SISO	5755	Ant2	5755	0	0	25	Pass
20C 138V	11AX40SISO	5755	Ant2	5755	0	0	25	Pass
-20C 120V	11AX40SISO	5755	Ant2	5755	0	0	25	Pass
-10C 120V	11AX40SISO	5755	Ant2	5755	0	0	25	Pass
0C 120V	11AX40SISO	5755	Ant2	5755	0	0	25	Pass
10C 120V	11AX40SISO	5755	Ant2	5755.04	40000	6.95	25	Pass
30C 120V	11AX40SISO	5755	Ant2	5755	0	0	25	Pass
40C 120V	11AX40SISO	5755	Ant2	5755	0	0	25	Pass
50C 120V	11AX40SISO	5755	Ant2	5755	0	0	25	Pass

20C 102V	11AX40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
20C 120V	11AX40SISO	5795	Ant2	5795	0	0	25	Pass
20C 138V	11AX40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
-20C 120V	11AX40SISO	5795	Ant2	5795	0	0	25	Pass
-10C 120V	11AX40SISO	5795	Ant2	5795	0	0	25	Pass
0C 120V	11AX40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
10C 120V	11AX40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
30C 120V	11AX40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
40C 120V	11AX40SISO	5795	Ant2	5795	0	0	25	Pass
50C 120V	11AX40SISO	5795	Ant2	5795	0	0	25	Pass
20C 102V	11AX80SISO	5210	Ant1	5210	0	0	25	Pass
20C 120V	11AX80SISO	5210	Ant1	5210	0	0	25	Pass
20C 138V	11AX80SISO	5210	Ant1	5210	0	0	25	Pass
-20C 120V	11AX80SISO	5210	Ant1	5210.08	80000	15.36	25	Pass
-10C 120V	11AX80SISO	5210	Ant1	5210	0	0	25	Pass
0C 120V	11AX80SISO	5210	Ant1	5210.08	80000	15.36	25	Pass
10C 120V	11AX80SISO	5210	Ant1	5210.08	80000	15.36	25	Pass
30C 120V	11AX80SISO	5210	Ant1	5210	0	0	25	Pass
40C 120V	11AX80SISO	5210	Ant1	5210.08	80000	15.36	25	Pass
50C 120V	11AX80SISO	5210	Ant1	5210.08	80000	15.36	25	Pass
20C 102V	11AX80SISO	5775	Ant1	5775.08	80000	13.85	25	Pass
20C 120V	11AX80SISO	5775	Ant1	5775	0	0	25	Pass
20C 138V	11AX80SISO	5775	Ant1	5775.08	80000	13.85	25	Pass
-20C 120V	11AX80SISO	5775	Ant1	5774.84	-160000	-27.71	25	Pass
-10C 120V	11AX80SISO	5775	Ant1	5775	0	0	25	Pass
0C 120V	11AX80SISO	5775	Ant1	5775	0	0	25	Pass
10C 120V	11AX80SISO	5775	Ant1	5775	0	0	25	Pass
30C 120V	11AX80SISO	5775	Ant1	5775.08	80000	13.85	25	Pass
40C 120V	11AX80SISO	5775	Ant1	5775	0	0	25	Pass
50C 120V	11AX80SISO	5775	Ant1	5774.92	-80000	-13.85	25	Pass
20C 102V	11AX80SISO	5210	Ant2	5210.08	80000	15.36	25	Pass
20C 120V	11AX80SISO	5210	Ant2	5210.08	80000	15.36	25	Pass
20C 138V	11AX80SISO	5210	Ant2	5210.08	80000	15.36	25	Pass
-20C 120V	11AX80SISO	5210	Ant2	5210	0	0	25	Pass
-10C 120V	11AX80SISO	5210	Ant2	5210.08	80000	15.36	25	Pass
0C 120V	11AX80SISO	5210	Ant2	5210	0	0	25	Pass
10C 120V	11AX80SISO	5210	Ant2	5210.08	80000	15.36	25	Pass
30C 120V	11AX80SISO	5210	Ant2	5210	0	0	25	Pass
40C 120V	11AX80SISO	5210	Ant2	5210	0	0	25	Pass
50C 120V	11AX80SISO	5210	Ant2	5210	0	0	25	Pass
20C 102V	11AX80SISO	5775	Ant2	5775.08	80000	13.85	25	Pass
20C 120V	11AX80SISO	5775	Ant2	5775.08	80000	13.85	25	Pass

20C 138V	11AX80SISO	5775	Ant2	5775.08	80000	13.85	25	Pass
-20C 120V	11AX80SISO	5775	Ant2	5775.08	80000	13.85	25	Pass
-10C 120V	11AX80SISO	5775	Ant2	5775	0	0	25	Pass
0C 120V	11AX80SISO	5775	Ant2	5775.08	80000	13.85	25	Pass
10C 120V	11AX80SISO	5775	Ant2	5775	0	0	25	Pass
30C 120V	11AX80SISO	5775	Ant2	5775.08	80000	13.85	25	Pass
40C 120V	11AX80SISO	5775	Ant2	5775.08	80000	13.85	25	Pass
50C 120V	11AX80SISO	5775	Ant2	5775	0	0	25	Pass
20C 102V	11N20SISO	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 120V	11N20SISO	5180	Ant1	5180	0	0	25	Pass
20C 138V	11N20SISO	5180	Ant1	5180	0	0	25	Pass
-20C 120V	11N20SISO	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 120V	11N20SISO	5180	Ant1	5179.96	-40000	-7.72	25	Pass
0C 120V	11N20SISO	5180	Ant1	5180	0	0	25	Pass
10C 120V	11N20SISO	5180	Ant1	5180	0	0	25	Pass
30C 120V	11N20SISO	5180	Ant1	5180	0	0	25	Pass
40C 120V	11N20SISO	5180	Ant1	5180	0	0	25	Pass
50C 120V	11N20SISO	5180	Ant1	5180	0	0	25	Pass
20C 102V	11N20SISO	5200	Ant1	5200	0	0	25	Pass
20C 120V	11N20SISO	5200	Ant1	5200	0	0	25	Pass
20C 138V	11N20SISO	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-20C 120V	11N20SISO	5200	Ant1	5200	0	0	25	Pass
-10C 120V	11N20SISO	5200	Ant1	5199.98	-20000	-3.85	25	Pass
0C 120V	11N20SISO	5200	Ant1	5200	0	0	25	Pass
10C 120V	11N20SISO	5200	Ant1	5199.98	-20000	-3.85	25	Pass
30C 120V	11N20SISO	5200	Ant1	5200	0	0	25	Pass
40C 120V	11N20SISO	5200	Ant1	5200	0	0	25	Pass
50C 120V	11N20SISO	5200	Ant1	5200	0	0	25	Pass
20C 102V	11N20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	11N20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 138V	11N20SISO	5240	Ant1	5240	0	0	25	Pass
-20C 120V	11N20SISO	5240	Ant1	5240	0	0	25	Pass
-10C 120V	11N20SISO	5240	Ant1	5240	0	0	25	Pass
0C 120V	11N20SISO	5240	Ant1	5240	0	0	25	Pass
10C 120V	11N20SISO	5240	Ant1	5240	0	0	25	Pass
30C 120V	11N20SISO	5240	Ant1	5240	0	0	25	Pass
40C 120V	11N20SISO	5240	Ant1	5239.98	-20000	-3.82	25	Pass
50C 120V	11N20SISO	5240	Ant1	5240	0	0	25	Pass
20C 102V	11N20SISO	5745	Ant1	5745	0	0	25	Pass
20C 120V	11N20SISO	5745	Ant1	5745	0	0	25	Pass
20C 138V	11N20SISO	5745	Ant1	5745	0	0	25	Pass
-20C 120V	11N20SISO	5745	Ant1	5744.98	-20000	-3.48	25	Pass

-10C 120V	11N20SISO	5745	Ant1	5745	0	0	25	Pass
0C 120V	11N20SISO	5745	Ant1	5745	0	0	25	Pass
10C 120V	11N20SISO	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 120V	11N20SISO	5745	Ant1	5745	0	0	25	Pass
40C 120V	11N20SISO	5745	Ant1	5745	0	0	25	Pass
50C 120V	11N20SISO	5745	Ant1	5745	0	0	25	Pass
20C 102V	11N20SISO	5785	Ant1	5785	0	0	25	Pass
20C 120V	11N20SISO	5785	Ant1	5785	0	0	25	Pass
20C 138V	11N20SISO	5785	Ant1	5785	0	0	25	Pass
-20C 120V	11N20SISO	5785	Ant1	5785	0	0	25	Pass
-10C 120V	11N20SISO	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 120V	11N20SISO	5785	Ant1	5785	0	0	25	Pass
10C 120V	11N20SISO	5785	Ant1	5785	0	0	25	Pass
30C 120V	11N20SISO	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 120V	11N20SISO	5785	Ant1	5784.98	-20000	-3.46	25	Pass
50C 120V	11N20SISO	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 102V	11N20SISO	5825	Ant1	5825	0	0	25	Pass
20C 120V	11N20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 138V	11N20SISO	5825	Ant1	5825	0	0	25	Pass
-20C 120V	11N20SISO	5825	Ant1	5825	0	0	25	Pass
-10C 120V	11N20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	11N20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	11N20SISO	5825	Ant1	5825	0	0	25	Pass
30C 120V	11N20SISO	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	11N20SISO	5825	Ant1	5825	0	0	25	Pass
50C 120V	11N20SISO	5825	Ant1	5825	0	0	25	Pass
20C 102V	11N20SISO	5180	Ant2	5180	0	0	25	Pass
20C 120V	11N20SISO	5180	Ant2	5180.08	80000	15.44	25	Pass
20C 138V	11N20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
-20C 120V	11N20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
-10C 120V	11N20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
0C 120V	11N20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
10C 120V	11N20SISO	5180	Ant2	5180.04	40000	7.72	25	Pass
30C 120V	11N20SISO	5180	Ant2	5180.04	40000	7.72	25	Pass
40C 120V	11N20SISO	5180	Ant2	5180	0	0	25	Pass
50C 120V	11N20SISO	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 102V	11N20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
20C 120V	11N20SISO	5200	Ant2	5200	0	0	25	Pass
20C 138V	11N20SISO	5200	Ant2	5200	0	0	25	Pass
-20C 120V	11N20SISO	5200	Ant2	5200.04	40000	7.69	25	Pass
-10C 120V	11N20SISO	5200	Ant2	5200	0	0	25	Pass
0C 120V	11N20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass

10C 120V	11N20SISO	5200	Ant2	5199.98	-20000	-3.85	25	Pass
30C 120V	11N20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
40C 120V	11N20SISO	5200	Ant2	5200.02	20000	3.85	25	Pass
50C 120V	11N20SISO	5200	Ant2	5200	0	0	25	Pass
20C 102V	11N20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 120V	11N20SISO	5240	Ant2	5240	0	0	25	Pass
20C 138V	11N20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
-20C 120V	11N20SISO	5240	Ant2	5240	0	0	25	Pass
-10C 120V	11N20SISO	5240	Ant2	5240	0	0	25	Pass
0C 120V	11N20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
10C 120V	11N20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
30C 120V	11N20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
40C 120V	11N20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
50C 120V	11N20SISO	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 102V	11N20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 120V	11N20SISO	5745	Ant2	5745	0	0	25	Pass
20C 138V	11N20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
-20C 120V	11N20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
-10C 120V	11N20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
0C 120V	11N20SISO	5745	Ant2	5745	0	0	25	Pass
10C 120V	11N20SISO	5745	Ant2	5745	0	0	25	Pass
30C 120V	11N20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
40C 120V	11N20SISO	5745	Ant2	5745	0	0	25	Pass
50C 120V	11N20SISO	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 102V	11N20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
20C 120V	11N20SISO	5785	Ant2	5785	0	0	25	Pass
20C 138V	11N20SISO	5785	Ant2	5785.04	40000	6.91	25	Pass
-20C 120V	11N20SISO	5785	Ant2	5785	0	0	25	Pass
-10C 120V	11N20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
0C 120V	11N20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
10C 120V	11N20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
30C 120V	11N20SISO	5785	Ant2	5785	0	0	25	Pass
40C 120V	11N20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
50C 120V	11N20SISO	5785	Ant2	5785.02	20000	3.46	25	Pass
20C 102V	11N20SISO	5825	Ant2	5825	0	0	25	Pass
20C 120V	11N20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 138V	11N20SISO	5825	Ant2	5825.04	40000	6.87	25	Pass
-20C 120V	11N20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
-10C 120V	11N20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
0C 120V	11N20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
10C 120V	11N20SISO	5825	Ant2	5825	0	0	25	Pass
30C 120V	11N20SISO	5825	Ant2	5825	0	0	25	Pass


40C 120V	11N20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
50C 120V	11N20SISO	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 102V	11N40SISO	5190	Ant1	5190	0	0	25	Pass
20C 120V	11N40SISO	5190	Ant1	5190	0	0	25	Pass
20C 138V	11N40SISO	5190	Ant1	5190.04	40000	7.71	25	Pass
-20C 120V	11N40SISO	5190	Ant1	5190	0	0	25	Pass
-10C 120V	11N40SISO	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 120V	11N40SISO	5190	Ant1	5190	0	0	25	Pass
10C 120V	11N40SISO	5190	Ant1	5190.04	40000	7.71	25	Pass
30C 120V	11N40SISO	5190	Ant1	5190	0	0	25	Pass
40C 120V	11N40SISO	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 120V	11N40SISO	5190	Ant1	5190	0	0	25	Pass
20C 102V	11N40SISO	5230	Ant1	5230	0	0	25	Pass
20C 120V	11N40SISO	5230	Ant1	5230	0	0	25	Pass
20C 138V	11N40SISO	5230	Ant1	5230	0	0	25	Pass
-20C 120V	11N40SISO	5230	Ant1	5230	0	0	25	Pass
-10C 120V	11N40SISO	5230	Ant1	5230	0	0	25	Pass
0C 120V	11N40SISO	5230	Ant1	5229.96	-40000	-7.65	25	Pass
10C 120V	11N40SISO	5230	Ant1	5230	0	0	25	Pass
30C 120V	11N40SISO	5230	Ant1	5230.04	40000	7.65	25	Pass
40C 120V	11N40SISO	5230	Ant1	5230	0	0	25	Pass
50C 120V	11N40SISO	5230	Ant1	5230	0	0	25	Pass
20C 102V	11N40SISO	5755	Ant1	5755	0	0	25	Pass
20C 120V	11N40SISO	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 138V	11N40SISO	5755	Ant1	5755	0	0	25	Pass
-20C 120V	11N40SISO	5755	Ant1	5755	0	0	25	Pass
-10C 120V	11N40SISO	5755	Ant1	5754.96	-40000	-6.95	25	Pass
0C 120V	11N40SISO	5755	Ant1	5754.96	-40000	-6.95	25	Pass
10C 120V	11N40SISO	5755	Ant1	5755	0	0	25	Pass
30C 120V	11N40SISO	5755	Ant1	5755	0	0	25	Pass
40C 120V	11N40SISO	5755	Ant1	5755	0	0	25	Pass
50C 120V	11N40SISO	5755	Ant1	5755	0	0	25	Pass
20C 102V	11N40SISO	5795	Ant1	5795	0	0	25	Pass
20C 120V	11N40SISO	5795	Ant1	5795	0	0	25	Pass
20C 138V	11N40SISO	5795	Ant1	5795	0	0	25	Pass
-20C 120V	11N40SISO	5795	Ant1	5795	0	0	25	Pass
-10C 120V	11N40SISO	5795	Ant1	5795	0	0	25	Pass
0C 120V	11N40SISO	5795	Ant1	5794.96	-40000	-6.9	25	Pass
10C 120V	11N40SISO	5795	Ant1	5795	0	0	25	Pass
30C 120V	11N40SISO	5795	Ant1	5795.08	80000	13.81	25	Pass
40C 120V	11N40SISO	5795	Ant1	5794.96	-40000	-6.9	25	Pass
50C 120V	11N40SISO	5795	Ant1	5795	0	0	25	Pass


20C 102V	11N40SISO	5190	Ant2	5190.04	40000	7.71	25	Pass
20C 120V	11N40SISO	5190	Ant2	5190	0	0	25	Pass
20C 138V	11N40SISO	5190	Ant2	5190.04	40000	7.71	25	Pass
-20C 120V	11N40SISO	5190	Ant2	5190.04	40000	7.71	25	Pass
-10C 120V	11N40SISO	5190	Ant2	5190.04	40000	7.71	25	Pass
0C 120V	11N40SISO	5190	Ant2	5190	0	0	25	Pass
10C 120V	11N40SISO	5190	Ant2	5190	0	0	25	Pass
30C 120V	11N40SISO	5190	Ant2	5190	0	0	25	Pass
40C 120V	11N40SISO	5190	Ant2	5190.04	40000	7.71	25	Pass
50C 120V	11N40SISO	5190	Ant2	5190	0	0	25	Pass
20C 102V	11N40SISO	5230	Ant2	5230	0	0	25	Pass
20C 120V	11N40SISO	5230	Ant2	5230	0	0	25	Pass
20C 138V	11N40SISO	5230	Ant2	5230	0	0	25	Pass
-20C 120V	11N40SISO	5230	Ant2	5229.96	-40000	-7.65	25	Pass
-10C 120V	11N40SISO	5230	Ant2	5230.04	40000	7.65	25	Pass
0C 120V	11N40SISO	5230	Ant2	5230	0	0	25	Pass
10C 120V	11N40SISO	5230	Ant2	5230.04	40000	7.65	25	Pass
30C 120V	11N40SISO	5230	Ant2	5229.96	-40000	-7.65	25	Pass
40C 120V	11N40SISO	5230	Ant2	5230.04	40000	7.65	25	Pass
50C 120V	11N40SISO	5230	Ant2	5230	0	0	25	Pass
20C 102V	11N40SISO	5755	Ant2	5755.04	40000	6.95	25	Pass
20C 120V	11N40SISO	5755	Ant2	5755.04	40000	6.95	25	Pass
20C 138V	11N40SISO	5755	Ant2	5755	0	0	25	Pass
-20C 120V	11N40SISO	5755	Ant2	5755.04	40000	6.95	25	Pass
-10C 120V	11N40SISO	5755	Ant2	5755	0	0	25	Pass
0C 120V	11N40SISO	5755	Ant2	5755	0	0	25	Pass
10C 120V	11N40SISO	5755	Ant2	5755	0	0	25	Pass
30C 120V	11N40SISO	5755	Ant2	5755	0	0	25	Pass
40C 120V	11N40SISO	5755	Ant2	5755	0	0	25	Pass
50C 120V	11N40SISO	5755	Ant2	5755	0	0	25	Pass
20C 102V	11N40SISO	5795	Ant2	5794.96	-40000	-6.9	25	Pass
20C 120V	11N40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
20C 138V	11N40SISO	5795	Ant2	5795	0	0	25	Pass
-20C 120V	11N40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
-10C 120V	11N40SISO	5795	Ant2	5795	0	0	25	Pass
0C 120V	11N40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
10C 120V	11N40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
30C 120V	11N40SISO	5795	Ant2	5795	0	0	25	Pass
40C 120V	11N40SISO	5795	Ant2	5795.04	40000	6.9	25	Pass
50C 120V	11N40SISO	5795	Ant2	5795	0	0	25	Pass

-6dB Bandwidth


Condition	Mode	Frequency (MHz)	Antenna	-6 dB Bandwidth (MHz)	Limit -6 dB Bandwidth (MHz)	Verdict
NVNT	11A	5745	Ant1	13.989	0.5	Pass
NVNT	11A	5785	Ant1	15.045	0.5	Pass
NVNT	11A	5825	Ant1	15.114	0.5	Pass
NVNT	11A	5745	Ant2	15.105	0.5	Pass
NVNT	11A	5785	Ant2	15.075	0.5	Pass
NVNT	11A	5825	Ant2	14.091	0.5	Pass
NVNT	11AC20SISO	5745	Ant1	14.973	0.5	Pass
NVNT	11AC20SISO	5785	Ant1	13.767	0.5	Pass
NVNT	11AC20SISO	5825	Ant1	13.173	0.5	Pass
NVNT	11AC20SISO	5745	Ant2	15.024	0.5	Pass
NVNT	11AC20SISO	5785	Ant2	15.057	0.5	Pass
NVNT	11AC20SISO	5825	Ant2	13.827	0.5	Pass
NVNT	11AC40SISO	5755	Ant1	28.218	0.5	Pass
NVNT	11AC40SISO	5795	Ant1	31.656	0.5	Pass
NVNT	11AC40SISO	5755	Ant2	30.612	0.5	Pass
NVNT	11AC40SISO	5795	Ant2	32.538	0.5	Pass
NVNT	11AC80SISO	5775	Ant1	55.092	0.5	Pass
NVNT	11AC80SISO	5775	Ant2	72.576	0.5	Pass
NVNT	11AX20SISO	5745	Ant1	13.725	0.5	Pass
NVNT	11AX20SISO	5785	Ant1	13.8	0.5	Pass
NVNT	11AX20SISO	5825	Ant1	15.015	0.5	Pass
NVNT	11AX20SISO	5745	Ant2	13.239	0.5	Pass
NVNT	11AX20SISO	5785	Ant2	15.054	0.5	Pass
NVNT	11AX20SISO	5825	Ant2	13.116	0.5	Pass
NVNT	11AX40SISO	5755	Ant1	31.338	0.5	Pass
NVNT	11AX40SISO	5795	Ant1	26.886	0.5	Pass
NVNT	11AX40SISO	5755	Ant2	28.806	0.5	Pass
NVNT	11AX40SISO	5795	Ant2	34.716	0.5	Pass
NVNT	11AX80SISO	5775	Ant1	63.024	0.5	Pass
NVNT	11AX80SISO	5775	Ant2	68.508	0.5	Pass
NVNT	11N20SISO	5745	Ant1	16.2	0.5	Pass
NVNT	11N20SISO	5785	Ant1	14.49	0.5	Pass
NVNT	11N20SISO	5825	Ant1	16.347	0.5	Pass
NVNT	11N20SISO	5745	Ant2	15.549	0.5	Pass
NVNT	11N20SISO	5785	Ant2	15.78	0.5	Pass
NVNT	11N20SISO	5825	Ant2	16.29	0.5	Pass
NVNT	11N40SISO	5755	Ant1	36.84	0.5	Pass
NVNT	11N40SISO	5795	Ant1	35.166	0.5	Pass

NVNT	11N40SISO	5755	Ant2	35.064	0.5	Pass
NVNT	11N40SISO	5795	Ant2	34.002	0.5	Pass

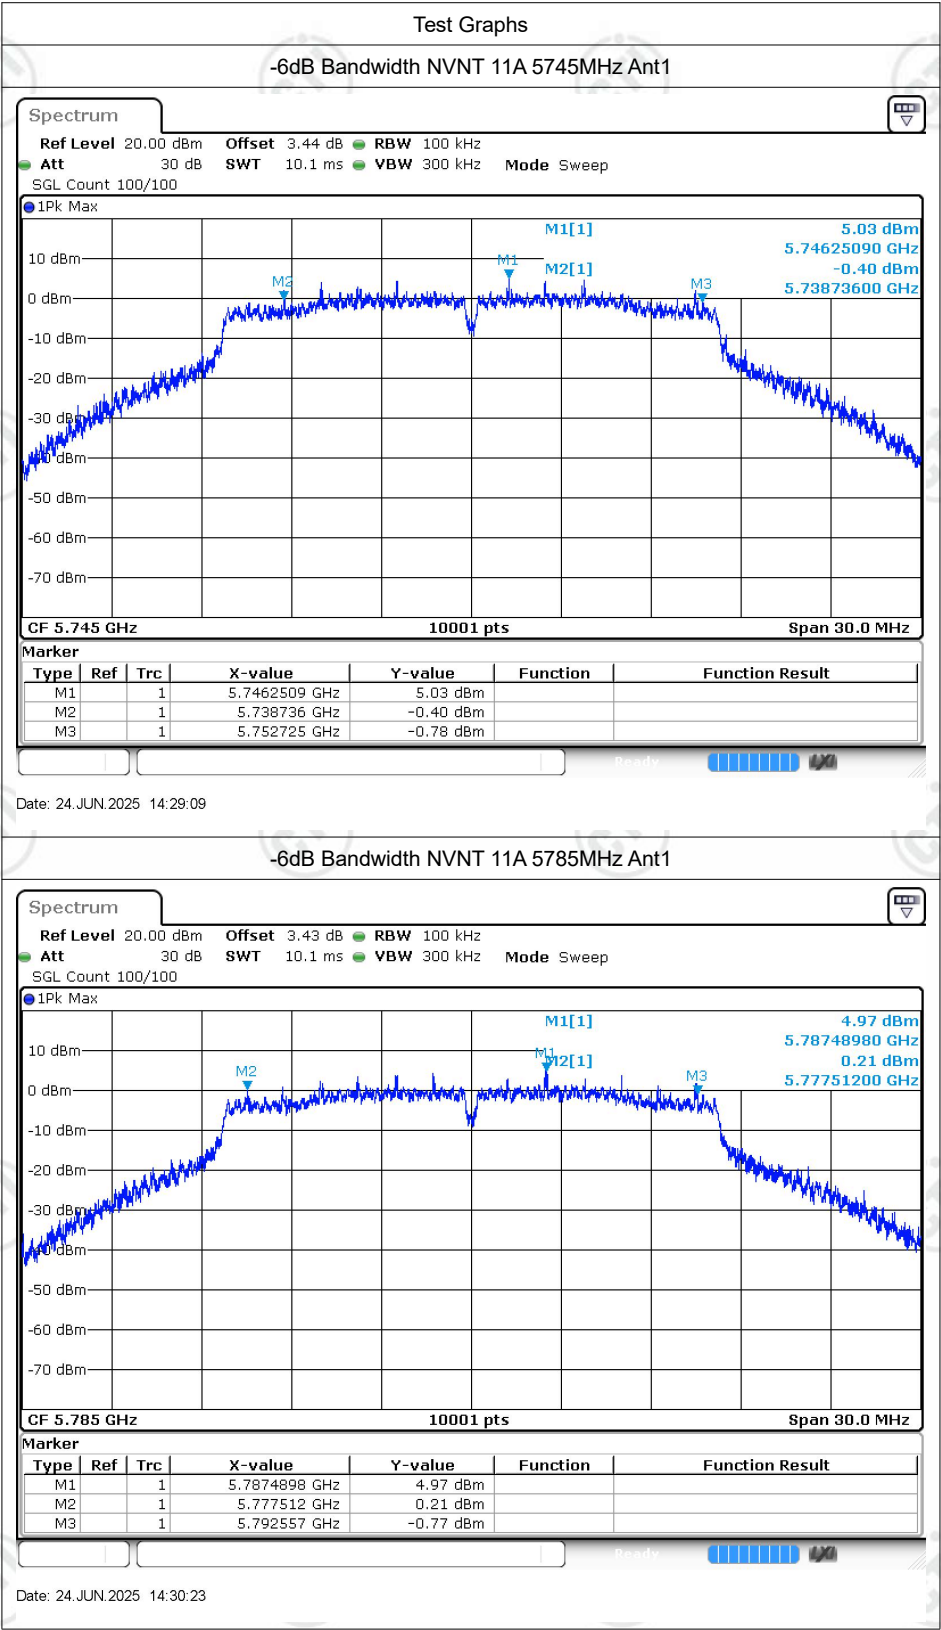


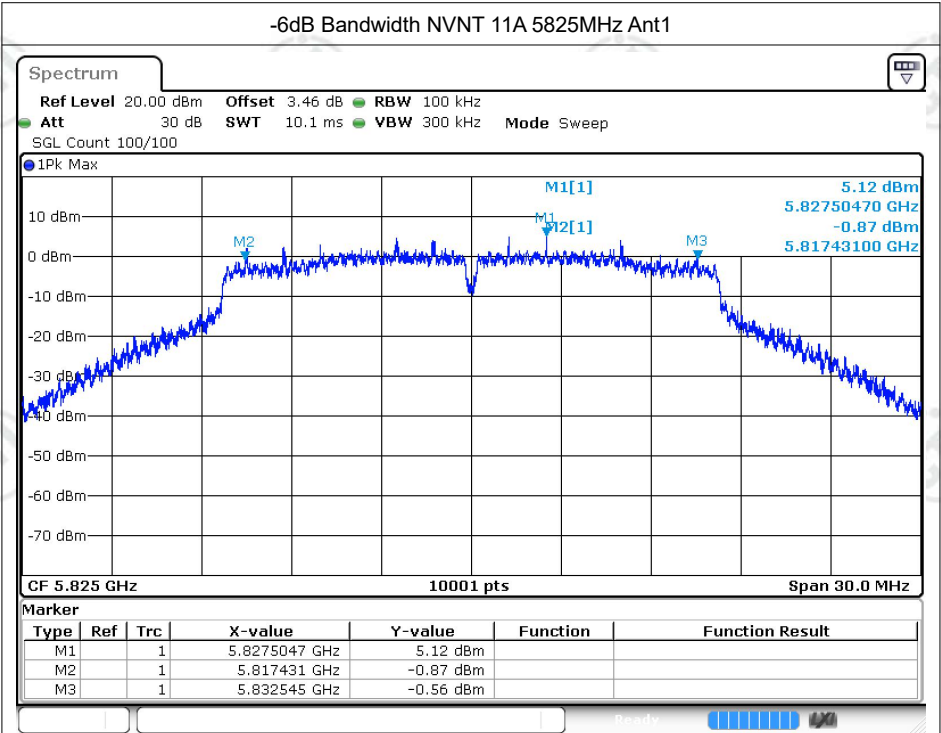


Date: 24 JUN 2025 14:31:44

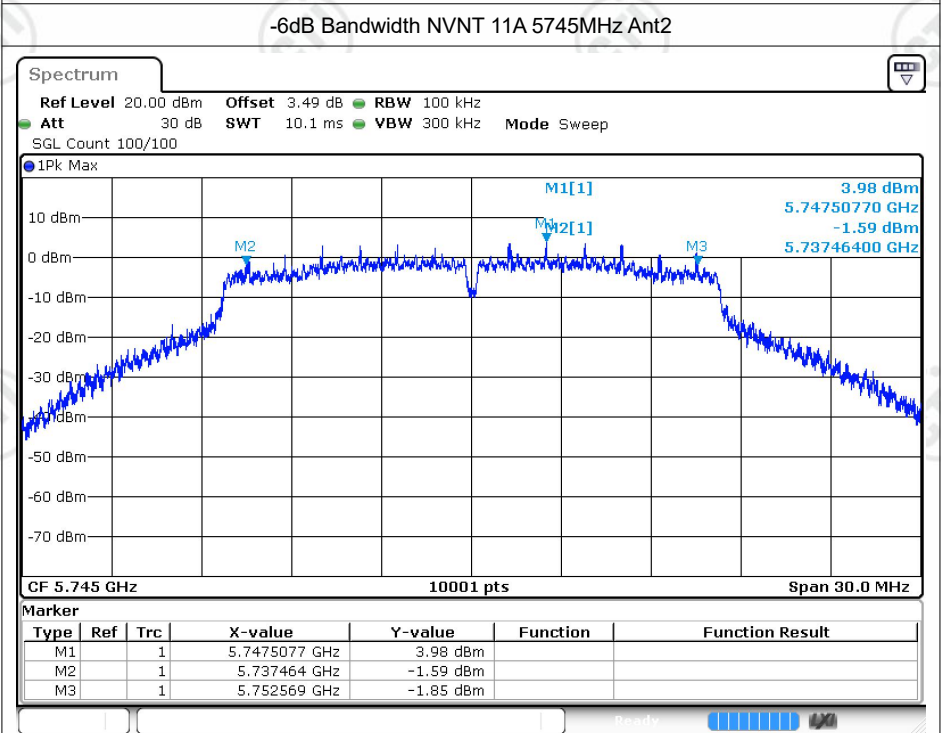


Date: 24 JUN 2025 17:02:21

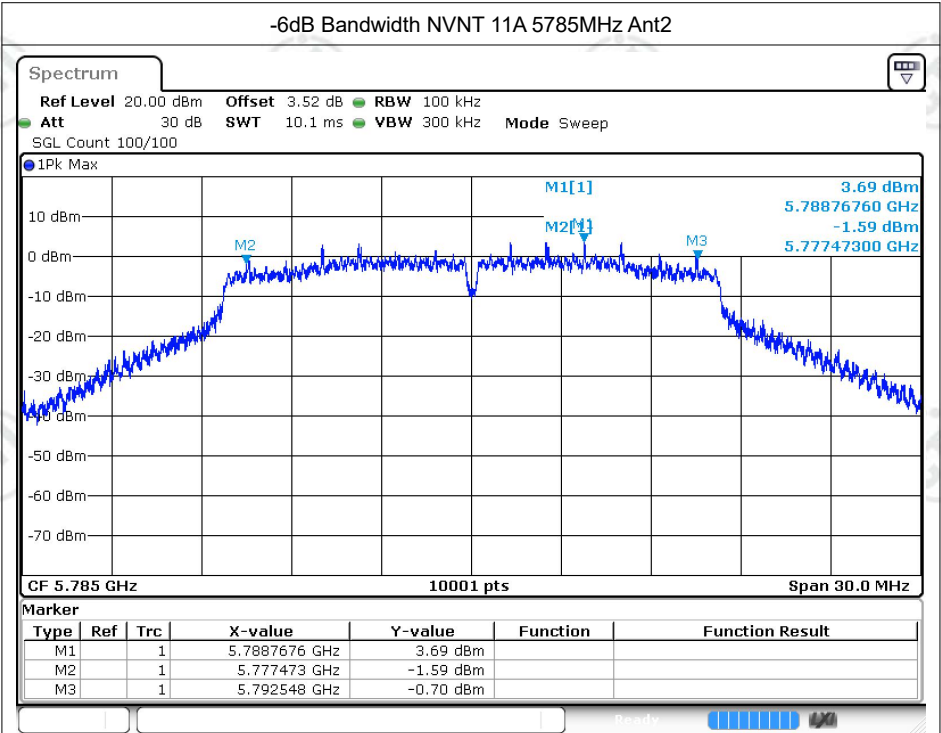


Date: 24.JUN.2025 17:04:27

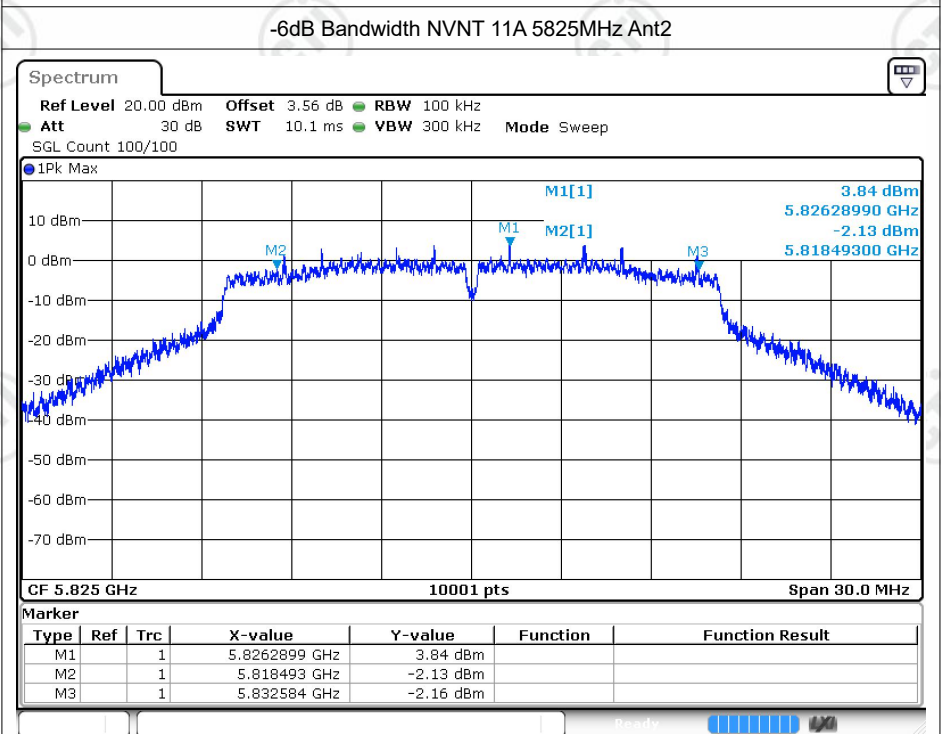


Date: 24.JUN.2025 17:05:58

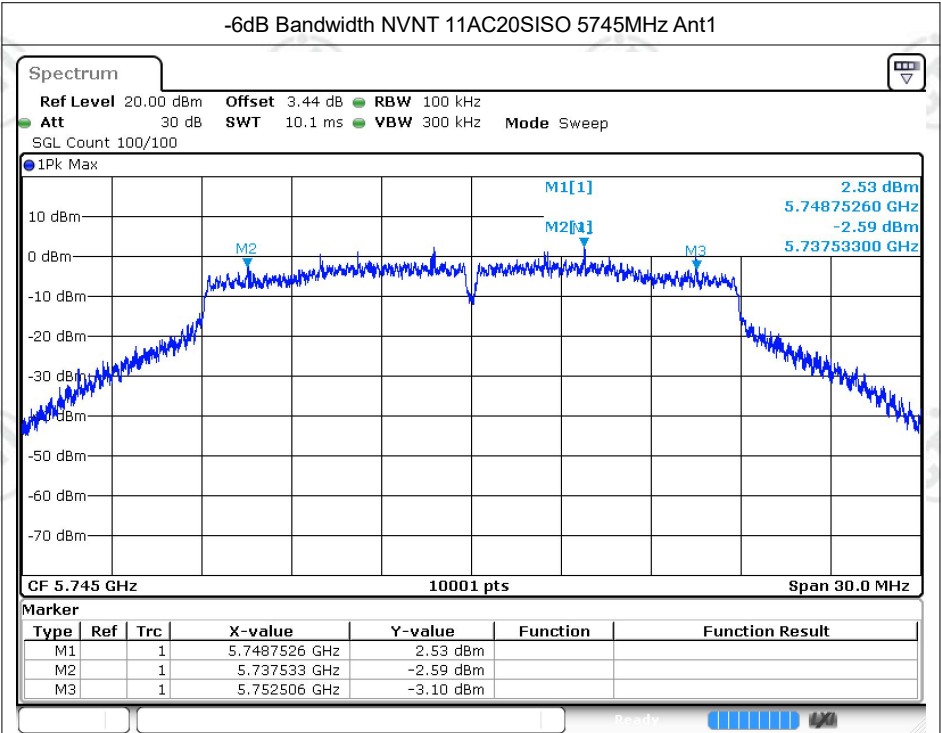


Date: 24.JUN.2025 15:34:35

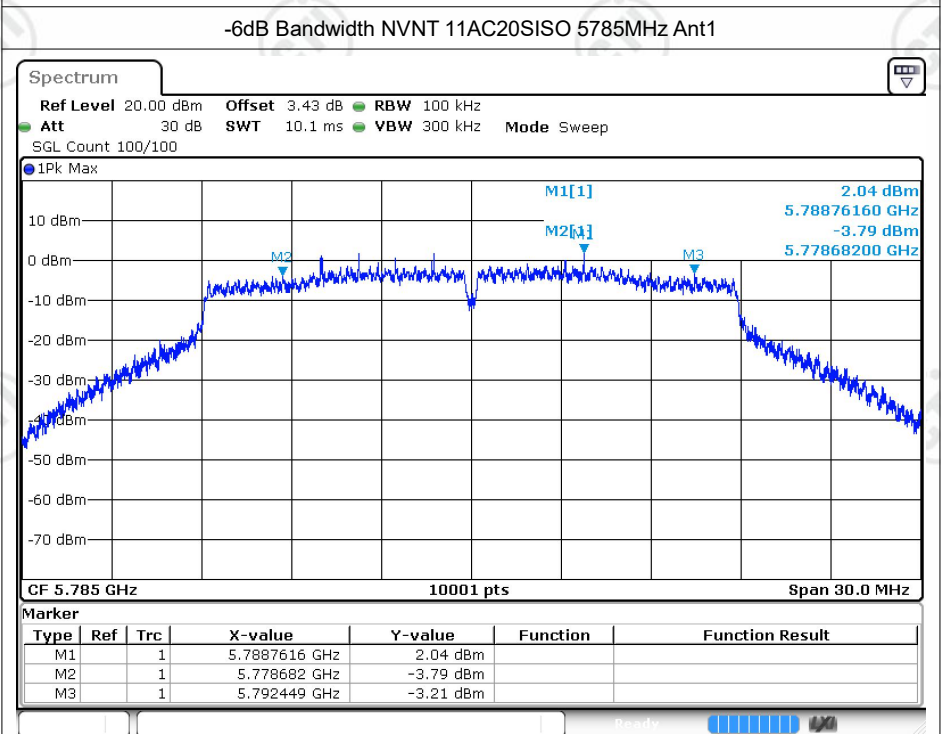


Date: 24.JUN.2025 15:36:08

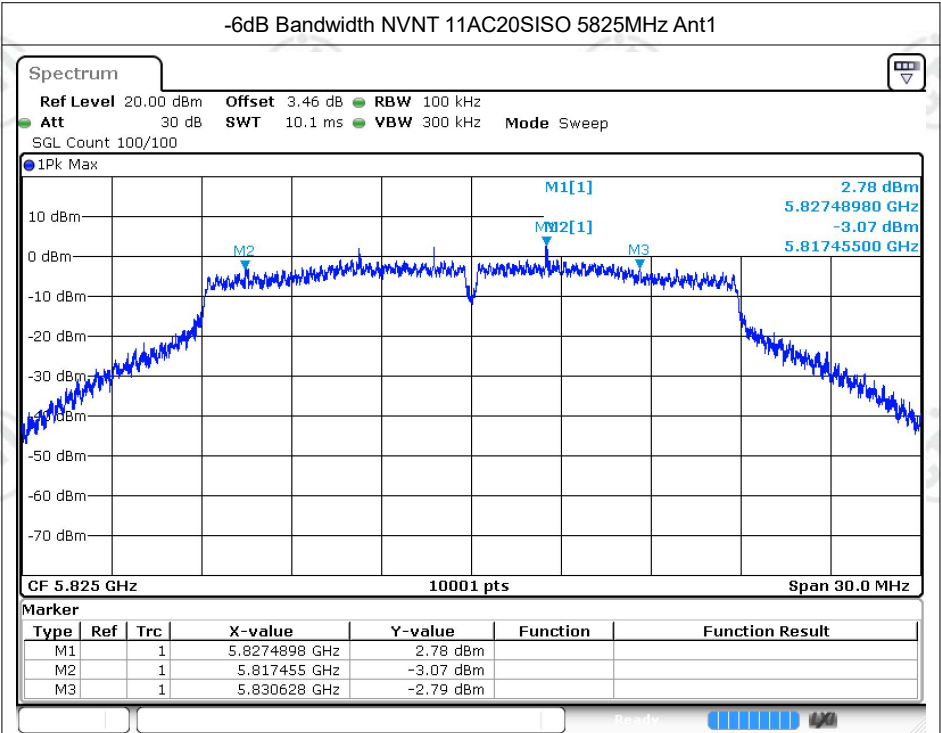


Date: 24 JUN 2025 15:37:57

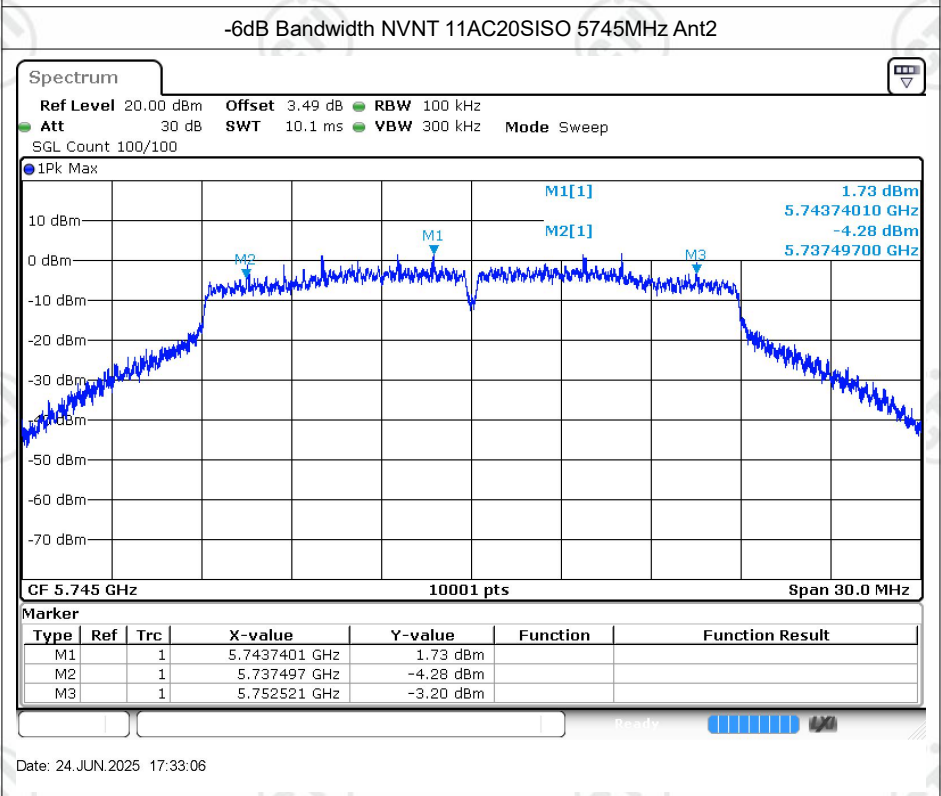


Date: 24 JUN 2025 17:33:06

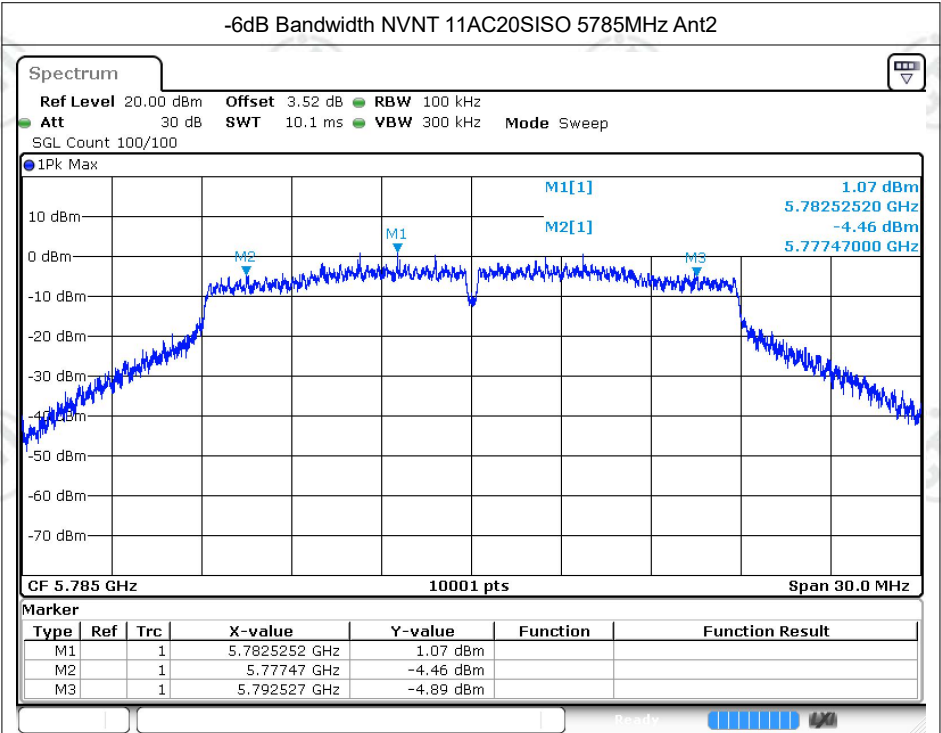


Date: 24.JUN.2025 17:35:11

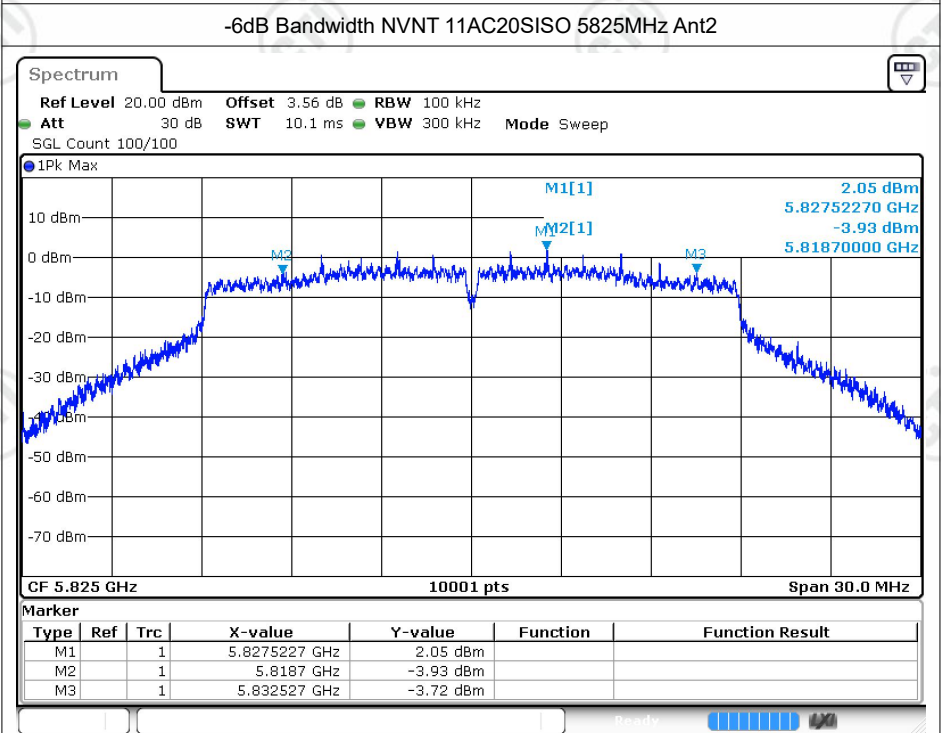


Date: 24.JUN.2025 17:36:28

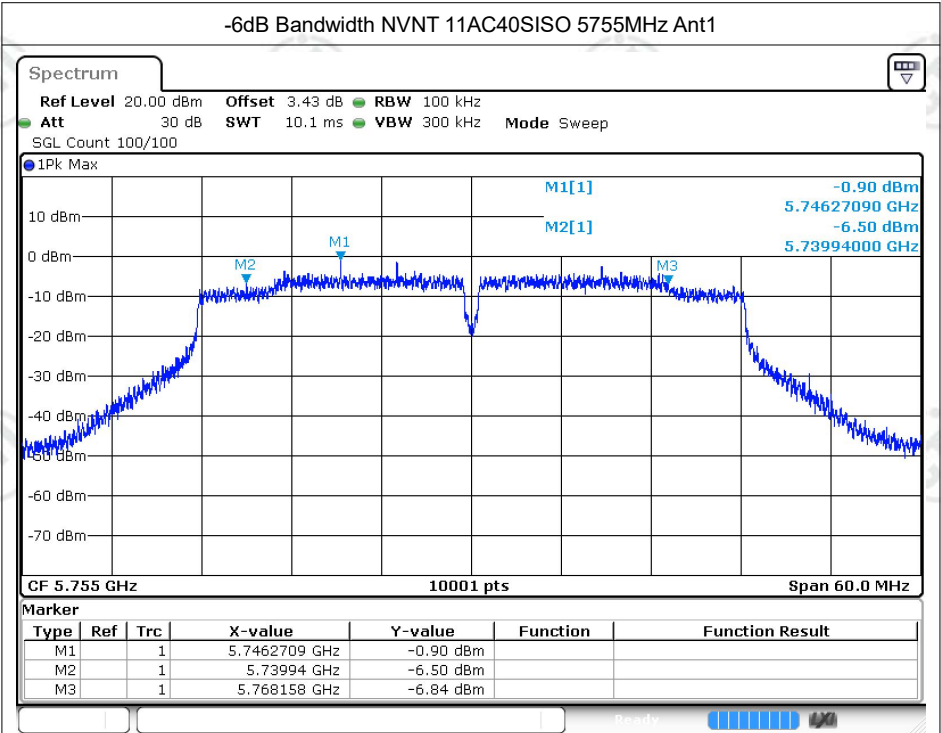


Date: 24.JUN.2025 16:09:54

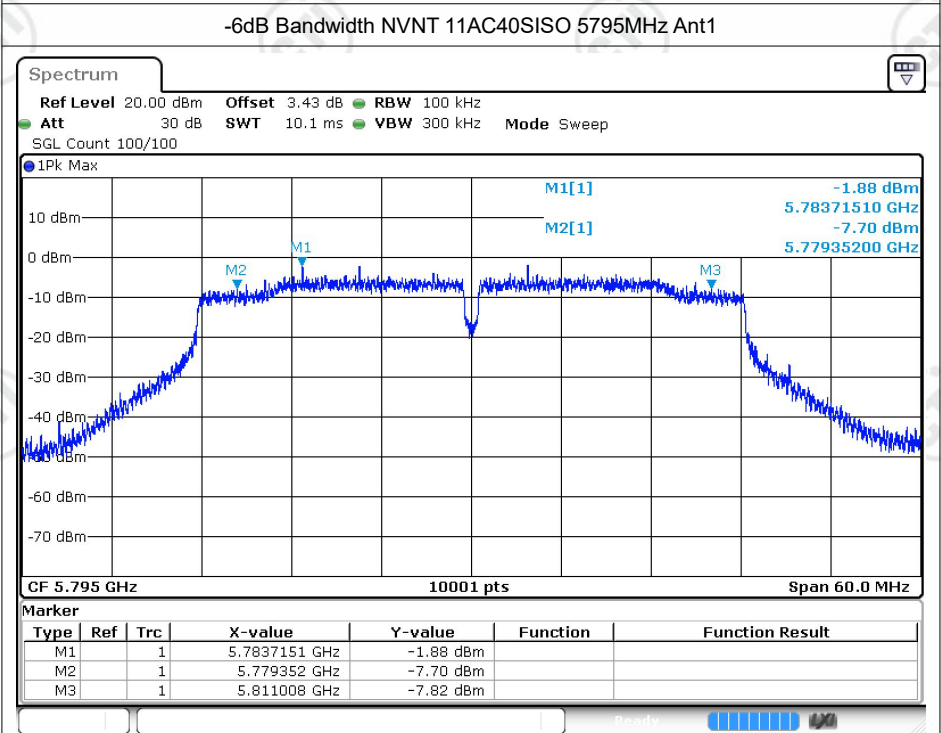


Date: 24.JUN.2025 16:12:47

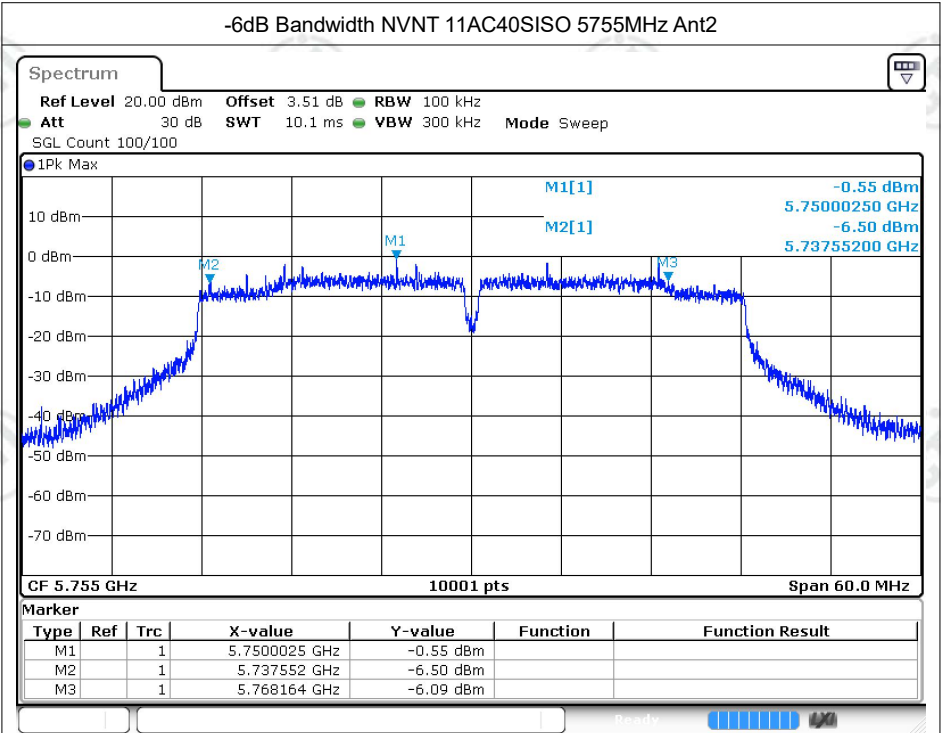


Date: 24 JUN.2025 18:04:31

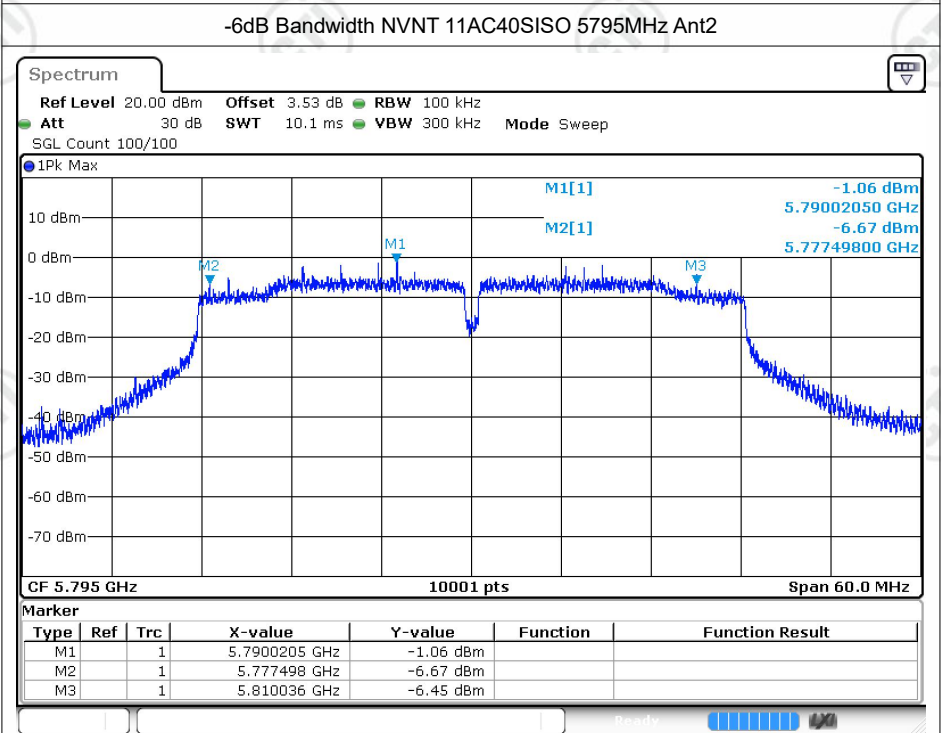


Date: 24 JUN.2025 18:06:09

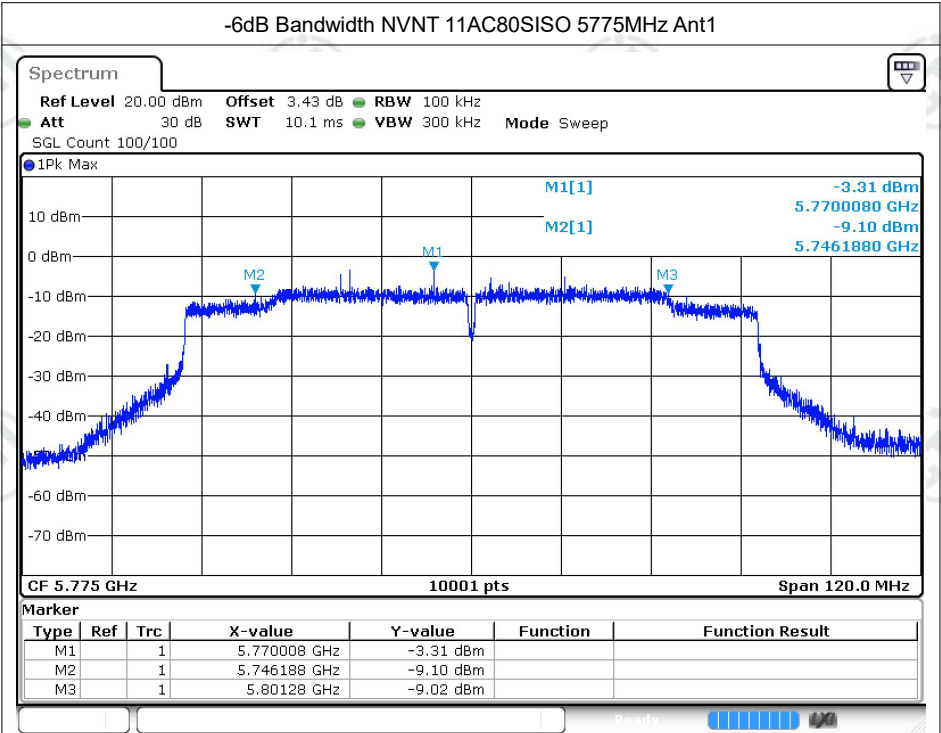


Date: 24.JUN.2025 16:28:16

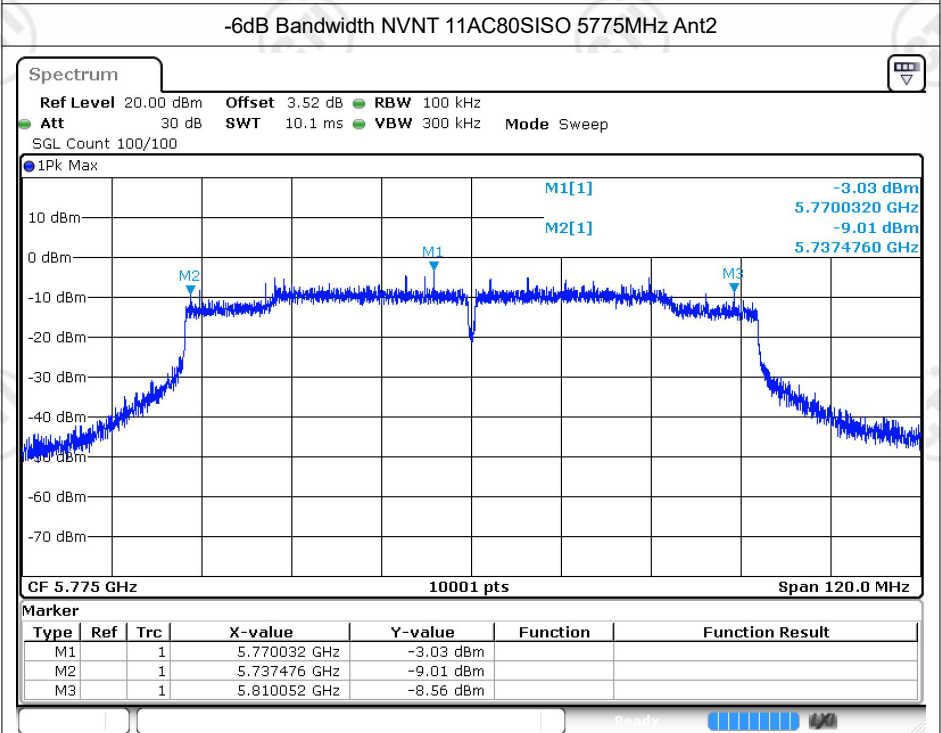

Date: 24.JUN.2025 18:22:13

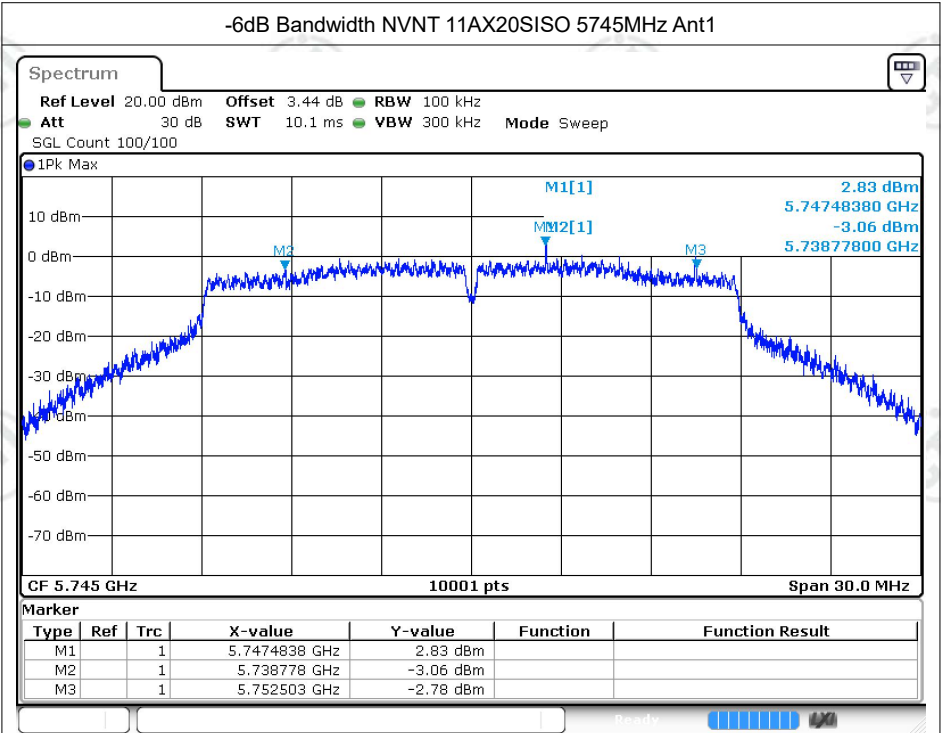

Date: 24.JUN.2025 15:45:12

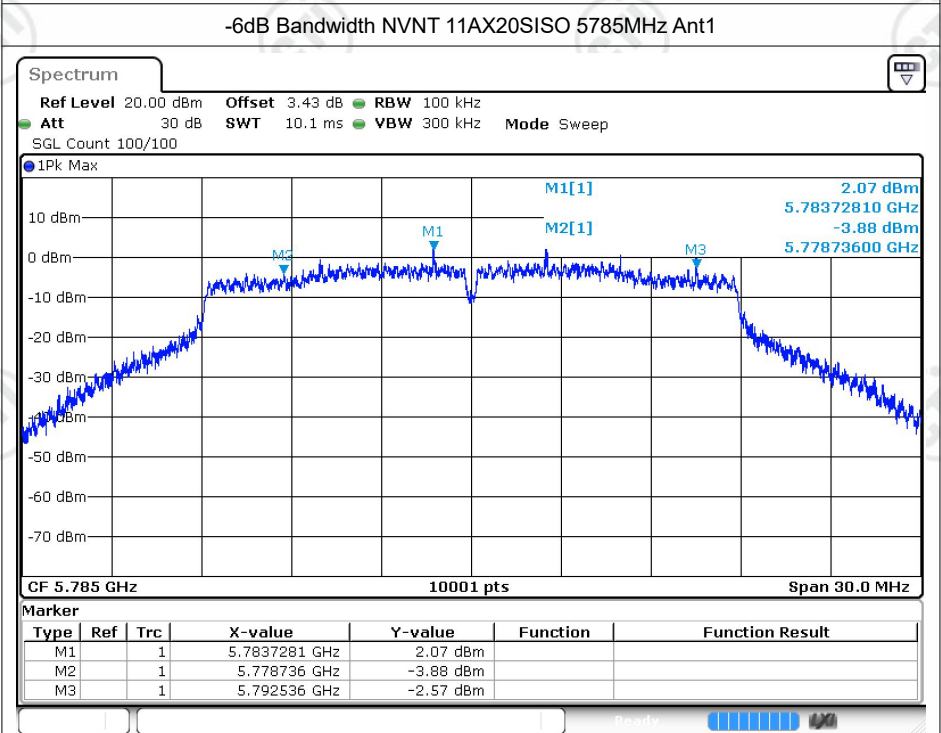

Date: 24.JUN.2025 15:47:23