



|      |      |      |      |         |        |      |      |       |         |      |      |
|------|------|------|------|---------|--------|------|------|-------|---------|------|------|
| NVNT | ac20 | 5180 | Ant2 | 5123.7  | -45.69 | 2.00 | -    | 51.54 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5180 | Ant2 | 5149.6  | -56.11 | 2.00 | 0.37 | 41.49 | Average | 54   | Pass |
| NVNT | ac20 | 5180 | Ant2 | 5150    | -48.37 | 2.00 | -    | 48.86 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5180 | Ant2 | 5150    | -56.67 | 2.00 | 0.37 | 40.93 | Average | 54   | Pass |
| NVNT | ac20 | 5240 | Ant2 | 5350    | -50.07 | 2.00 | -    | 47.16 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5240 | Ant2 | 5350    | -58.35 | 2.00 | 0.36 | 39.24 | Average | 54   | Pass |
| NVNT | ac20 | 5240 | Ant2 | 5418.48 | -47.34 | 2.00 | -    | 49.89 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5240 | Ant2 | 5393.76 | -57.17 | 2.00 | 0.36 | 40.42 | Average | 54   | Pass |
| NVNT | ac20 | 5240 | Ant2 | 5460    | -50.17 | 2.00 | -    | 47.06 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5240 | Ant2 | 5460    | -58.6  | 2.00 | 0.36 | 38.99 | Average | 54   | Pass |
| NVNT | ac40 | 5190 | Ant2 | 4500    | -50.4  | 2.00 | -    | 46.83 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5190 | Ant2 | 4500    | -58.82 | 2.00 | 0.71 | 39.12 | Average | 54   | Pass |
| NVNT | ac40 | 5190 | Ant2 | 5016.11 | -46.13 | 2.00 | -    | 51.10 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5190 | Ant2 | 5137.29 | -56.03 | 2.00 | 0.71 | 41.91 | Average | 54   | Pass |
| NVNT | ac40 | 5190 | Ant2 | 5150    | -48.44 | 2.00 | -    | 48.79 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5190 | Ant2 | 5150    | -56.11 | 2.00 | 0.71 | 41.83 | Average | 54   | Pass |
| NVNT | ac40 | 5230 | Ant2 | 5350    | -49.58 | 2.00 | -    | 47.65 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5230 | Ant2 | 5350    | -57.93 | 2.00 | 0.71 | 40.01 | Average | 54   | Pass |
| NVNT | ac40 | 5230 | Ant2 | 5430.84 | -46.87 | 2.00 | -    | 50.36 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5230 | Ant2 | 5377.38 | -56.97 | 2.00 | 0.71 | 40.97 | Average | 54   | Pass |
| NVNT | ac40 | 5230 | Ant2 | 5460    | -49.18 | 2.00 | -    | 48.05 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5230 | Ant2 | 5460    | -58.34 | 2.00 | 0.71 | 39.60 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | Ant2 | 5350    | -43.61 | 2.00 | -    | 53.62 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | Ant2 | 5350    | -55.29 | 2.00 | 1.31 | 43.25 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | Ant2 | 5351.1  | -39.31 | 2.00 | -    | 57.92 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | Ant2 | 5350.77 | -54.2  | 2.00 | 1.31 | 44.34 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | Ant2 | 5460    | -49.93 | 2.00 | -    | 47.30 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | Ant2 | 5460    | -57.82 | 2.00 | 1.31 | 40.72 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | Ant2 | 4500    | -49.45 | 2.00 | -    | 47.78 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | Ant2 | 4500    | -58.3  | 2.00 | 1.31 | 40.24 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | Ant2 | 5083.81 | -46.15 | 2.00 | -    | 51.08 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | Ant2 | 5146.22 | -55.76 | 2.00 | 1.31 | 42.78 | Average | 54   | Pass |
| NVNT | ac80 | 5210 | Ant2 | 5150    | -46.69 | 2.00 | -    | 50.54 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5210 | Ant2 | 5150    | -56.32 | 2.00 | 1.31 | 42.22 | Average | 54   | Pass |
| NVNT | ax20 | 5180 | Ant2 | 4500    | -51.01 | 2.00 | -    | 46.22 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5180 | Ant2 | 4500    | -58.88 | 2.00 | 0.43 | 38.78 | Average | 54   | Pass |
| NVNT | ax20 | 5180 | Ant2 | 5110.4  | -46.98 | 2.00 | -    | 50.25 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5180 | Ant2 | 5137    | -56.37 | 2.00 | 0.43 | 41.29 | Average | 54   | Pass |
| NVNT | ax20 | 5180 | Ant2 | 5150    | -48.11 | 2.00 | -    | 49.12 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5180 | Ant2 | 5150    | -56.72 | 2.00 | 0.43 | 40.94 | Average | 54   | Pass |
| NVNT | ax20 | 5240 | Ant2 | 5350    | -50.97 | 2.00 | -    | 46.26 | Peak    | 68.2 | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |         |        |      |      |       |         |      |      |
|------|------|------|------|---------|--------|------|------|-------|---------|------|------|
| NVNT | ax20 | 5240 | Ant2 | 5350    | -57.59 | 2.00 | 0.42 | 40.06 | Average | 54   | Pass |
| NVNT | ax20 | 5240 | Ant2 | 5441.52 | -47.32 | 2.00 | -    | 49.91 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5240 | Ant2 | 5385.6  | -57.12 | 2.00 | 0.42 | 40.53 | Average | 54   | Pass |
| NVNT | ax20 | 5240 | Ant2 | 5460    | -49.17 | 2.00 | -    | 48.06 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5240 | Ant2 | 5460    | -58.26 | 2.00 | 0.42 | 39.39 | Average | 54   | Pass |
| NVNT | ax40 | 5190 | Ant2 | 4500    | -49.65 | 2.00 | -    | 47.58 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5190 | Ant2 | 4500    | -58.5  | 2.00 | 0.78 | 39.51 | Average | 54   | Pass |
| NVNT | ax40 | 5190 | Ant2 | 4804.41 | -46.04 | 2.00 | -    | 51.19 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5190 | Ant2 | 5148.97 | -56.1  | 2.00 | 0.78 | 41.91 | Average | 54   | Pass |
| NVNT | ax40 | 5190 | Ant2 | 5150    | -47.6  | 2.00 | -    | 49.63 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5190 | Ant2 | 5150    | -56.28 | 2.00 | 0.78 | 41.73 | Average | 54   | Pass |
| NVNT | ax40 | 5230 | Ant2 | 5350    | -48.15 | 2.00 | -    | 49.08 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5230 | Ant2 | 5350    | -57.98 | 2.00 | 0.77 | 40.02 | Average | 54   | Pass |
| NVNT | ax40 | 5230 | Ant2 | 5442.45 | -46.28 | 2.00 | -    | 50.95 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5230 | Ant2 | 5381.7  | -56.79 | 2.00 | 0.77 | 41.21 | Average | 54   | Pass |
| NVNT | ax40 | 5230 | Ant2 | 5460    | -50.29 | 2.00 | -    | 46.94 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5230 | Ant2 | 5460    | -58.27 | 2.00 | 0.77 | 39.73 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | Ant2 | 5350    | -43.79 | 2.00 | -    | 53.44 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | Ant2 | 5350    | -56.45 | 2.00 | 1.35 | 42.13 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | Ant2 | 5350.11 | -43.79 | 2.00 | -    | 53.44 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | Ant2 | 5358.36 | -56.07 | 2.00 | 1.35 | 42.51 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | Ant2 | 5460    | -50.31 | 2.00 | -    | 46.92 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | Ant2 | 5460    | -57.75 | 2.00 | 1.35 | 40.83 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | Ant2 | 4500    | -47.76 | 2.00 | -    | 49.47 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | Ant2 | 4500    | -58.81 | 2.00 | 1.35 | 39.77 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | Ant2 | 5123.31 | -45.67 | 2.00 | -    | 51.56 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | Ant2 | 5146.22 | -55.61 | 2.00 | 1.35 | 42.97 | Average | 54   | Pass |
| NVNT | ax80 | 5210 | Ant2 | 5150    | -45.98 | 2.00 | -    | 51.25 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5210 | Ant2 | 5150    | -56.07 | 2.00 | 1.35 | 42.51 | Average | 54   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Restrict Band NVNT a 5180MHz Ant2 Peak

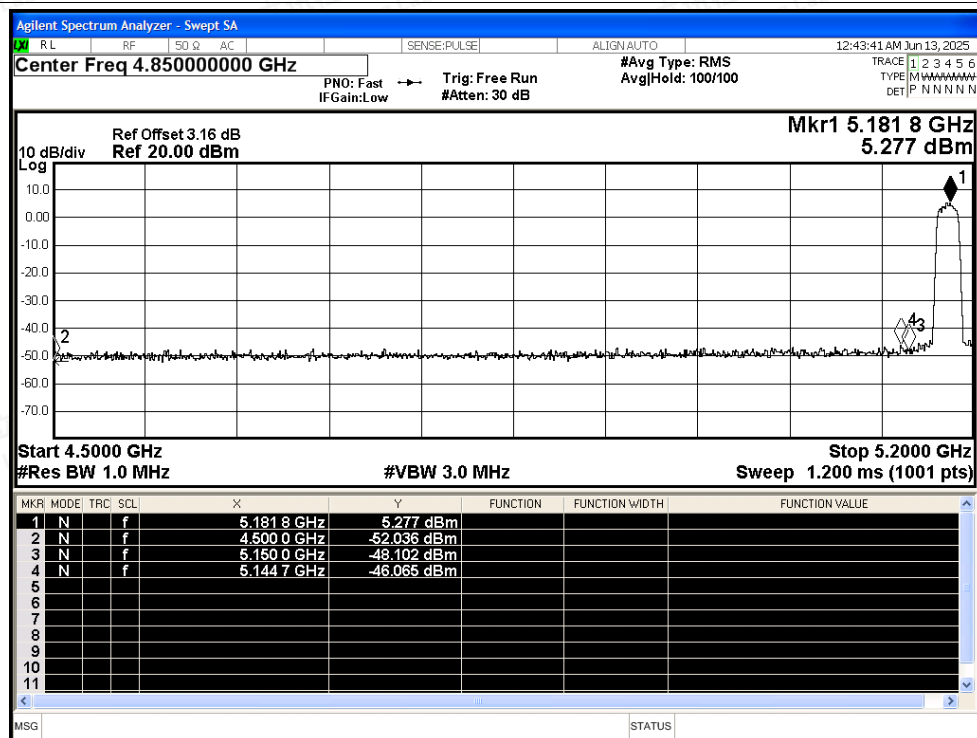

## Restrict Band NVNT a 5180MHz Ant2 Average

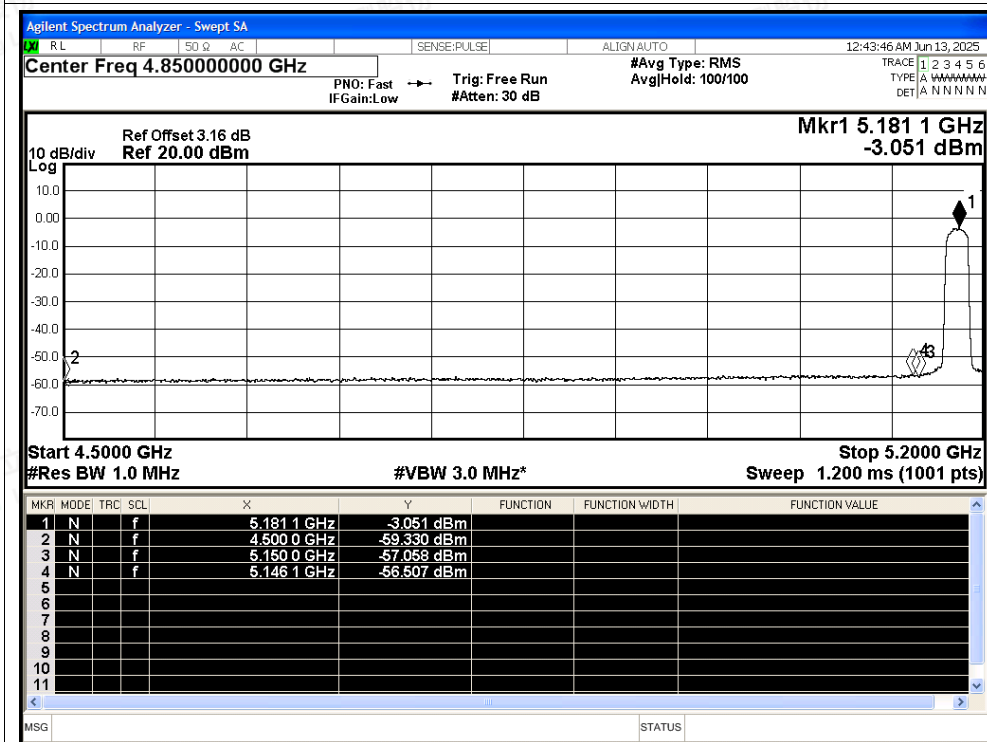

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT a 5240MHz Ant2 Peak

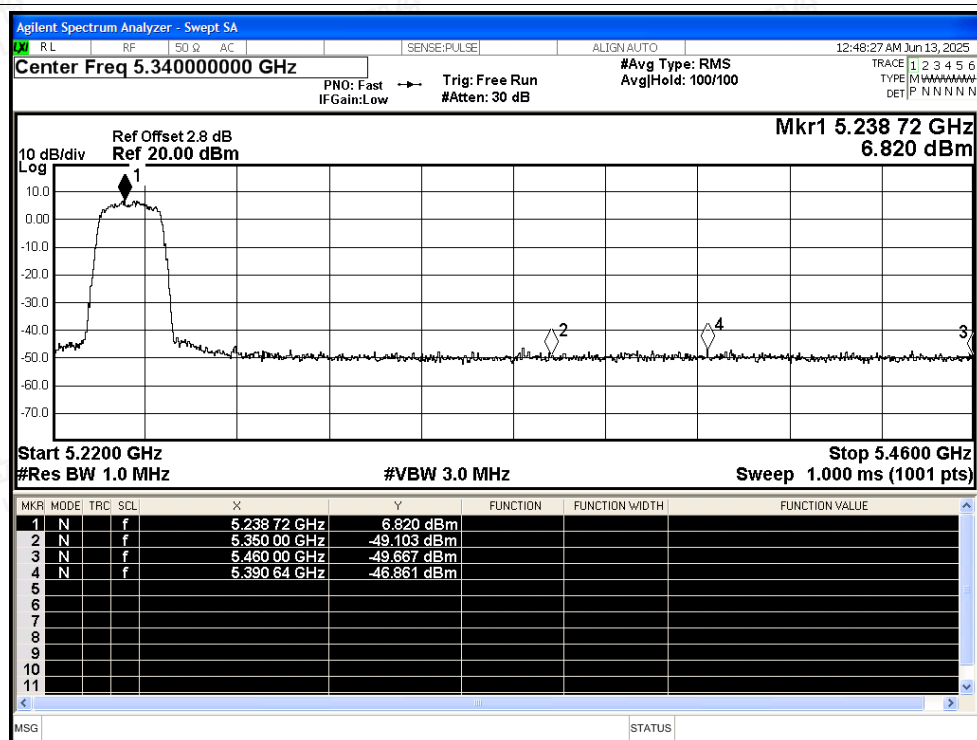

## Restrict Band NVNT a 5240MHz Ant2 Average

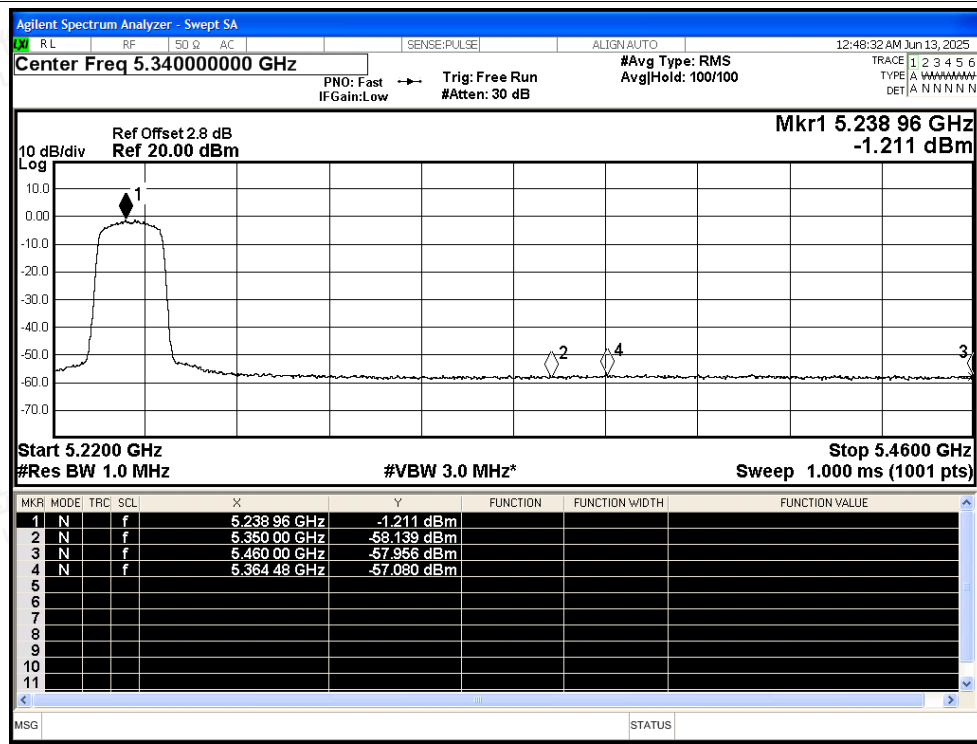

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5180MHz Ant2 Peak

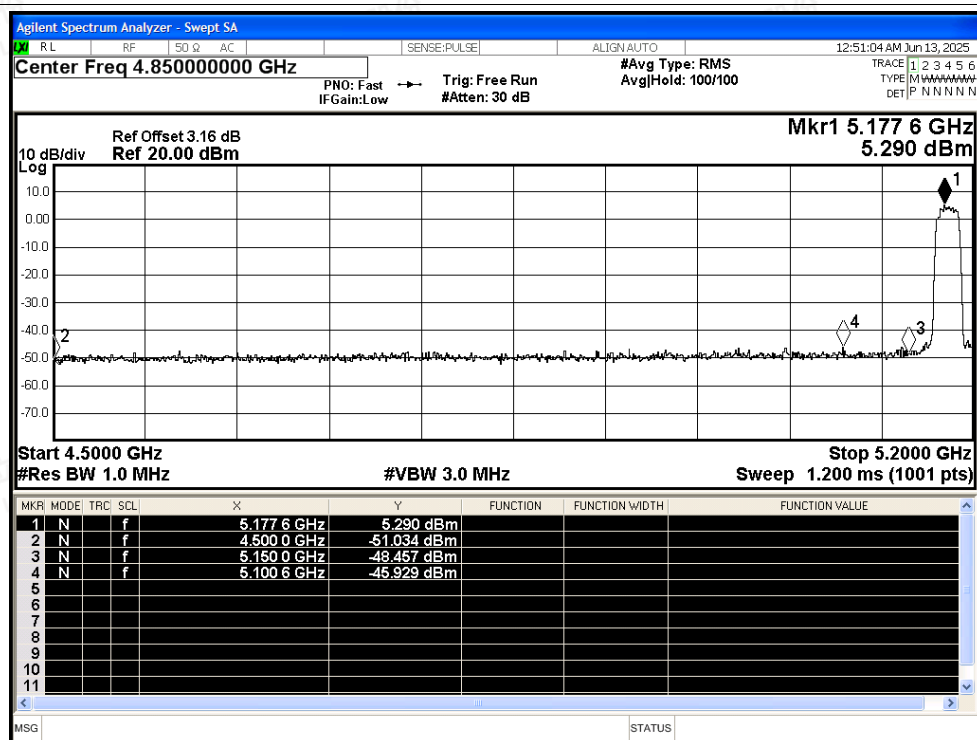

## Restrict Band NVNT n20 5180MHz Ant2 Average

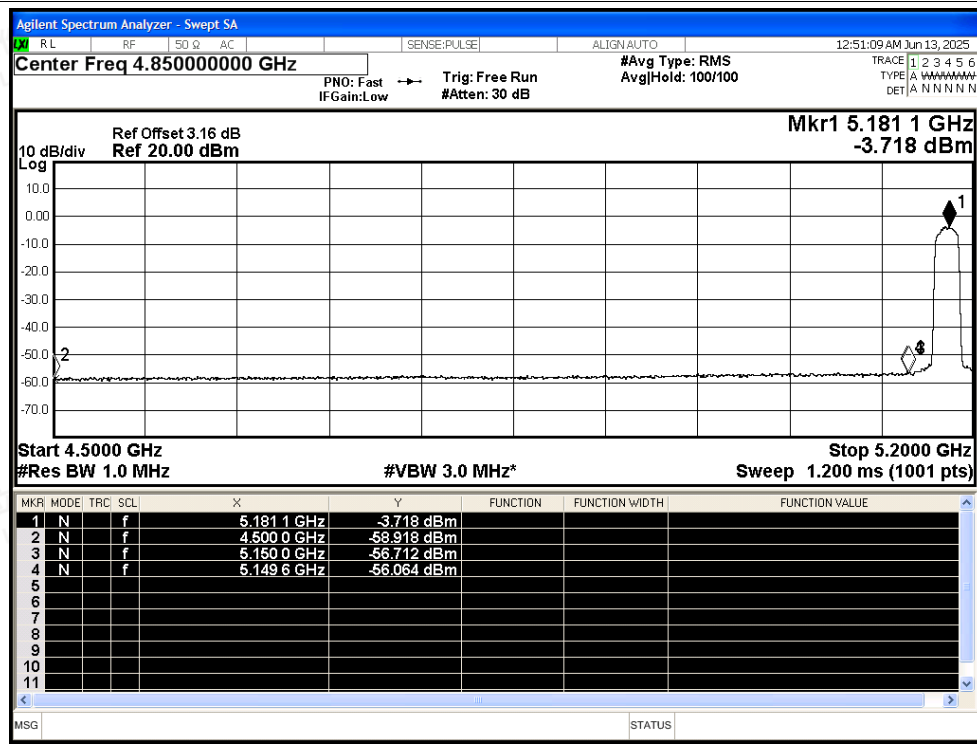

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5240MHz Ant2 Peak

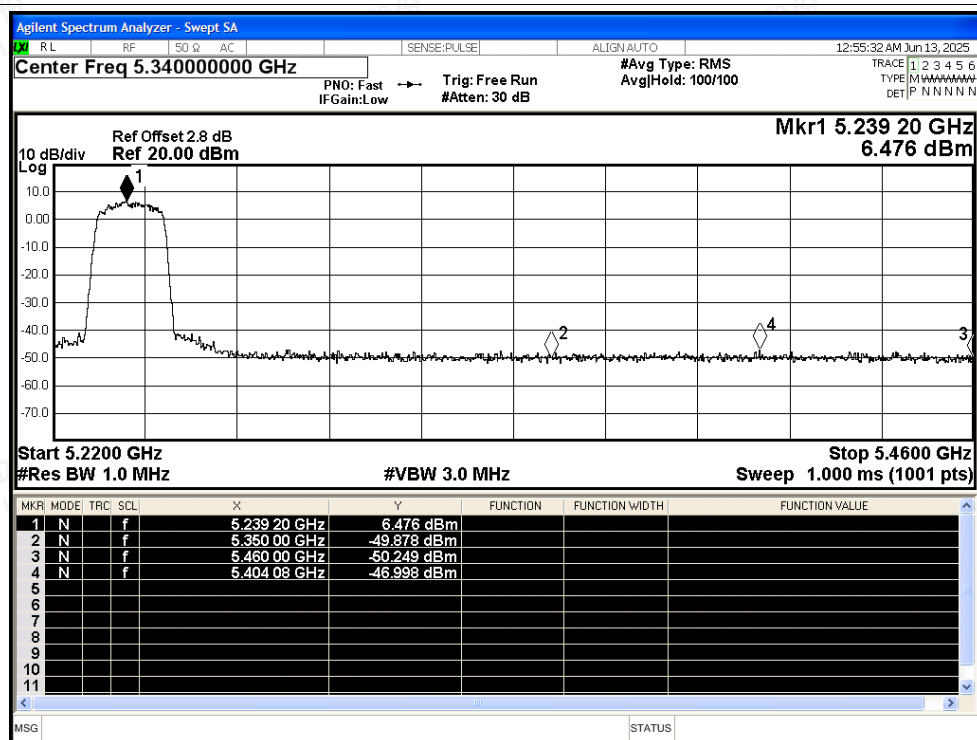

## Restrict Band NVNT n20 5240MHz Ant2 Average

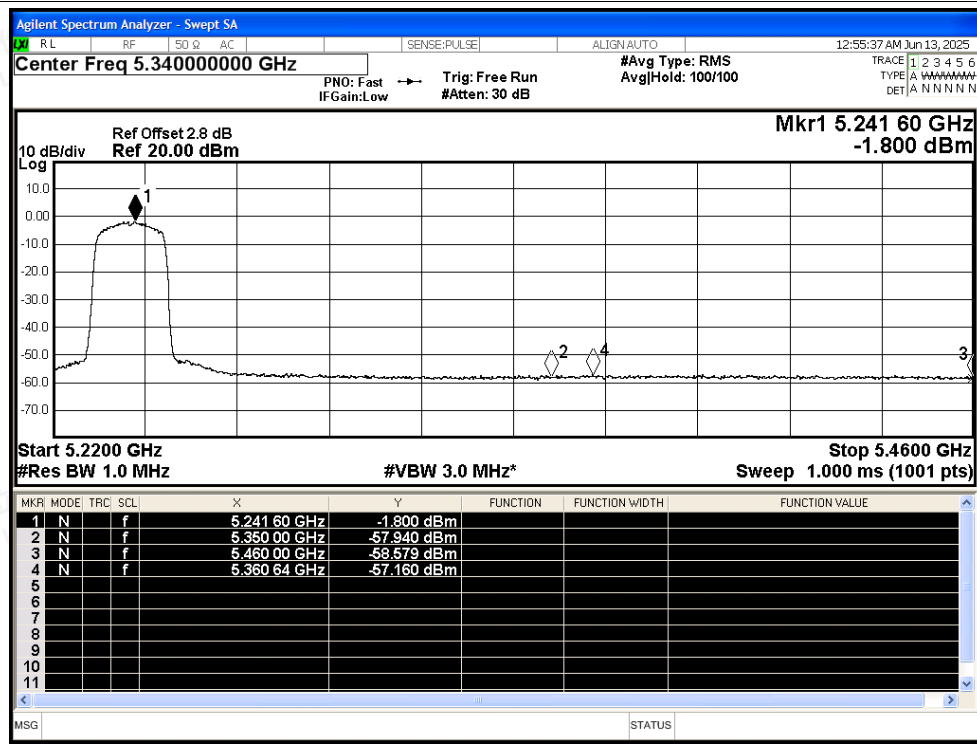

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5190MHz Ant2 Peak

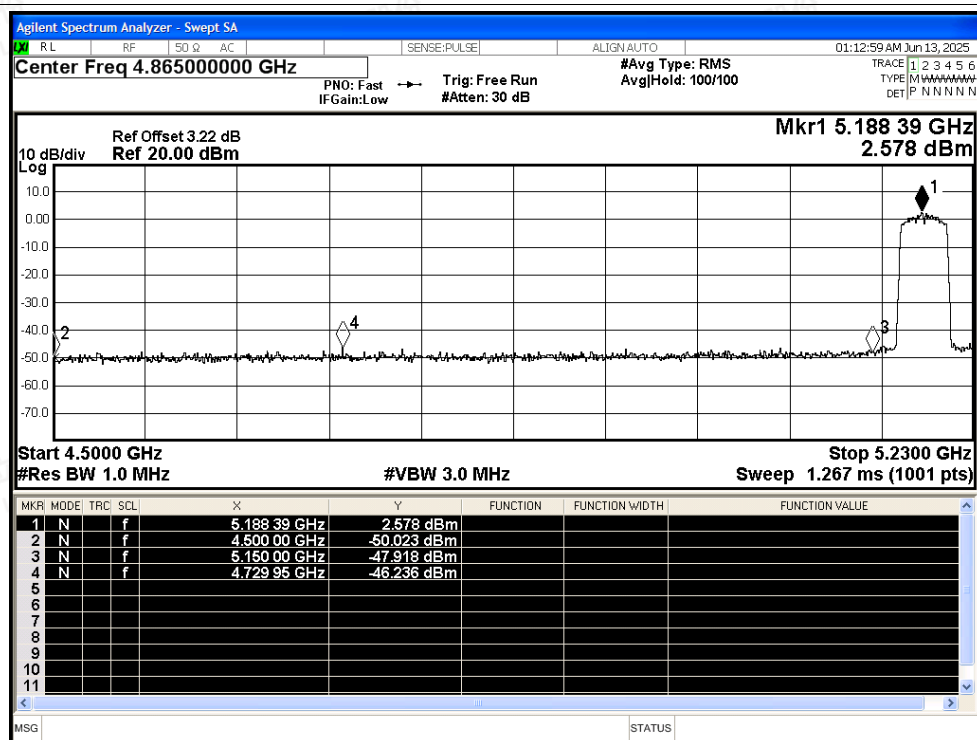

## Restrict Band NVNT n40 5190MHz Ant2 Average

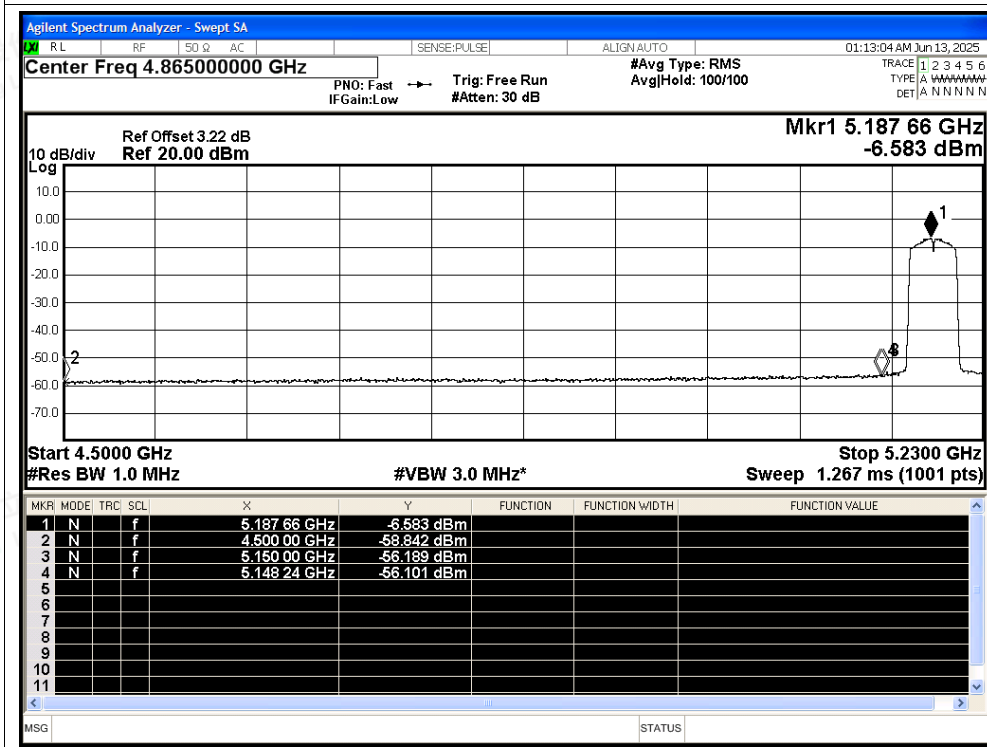

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5230MHz Ant2 Peak

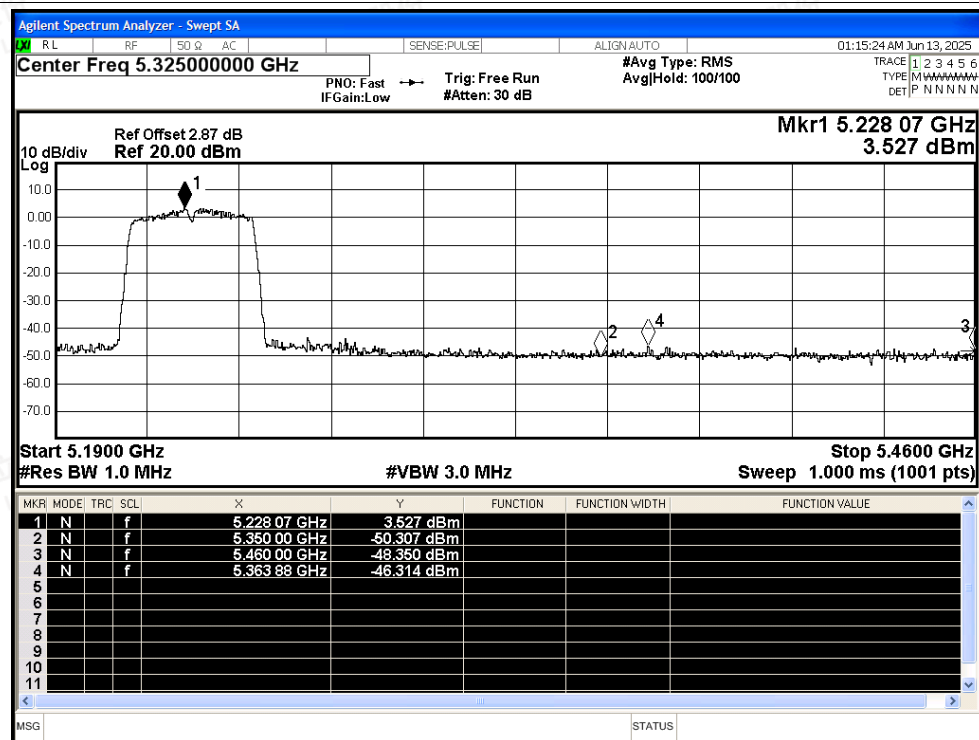

## Restrict Band NVNT n40 5230MHz Ant2 Average

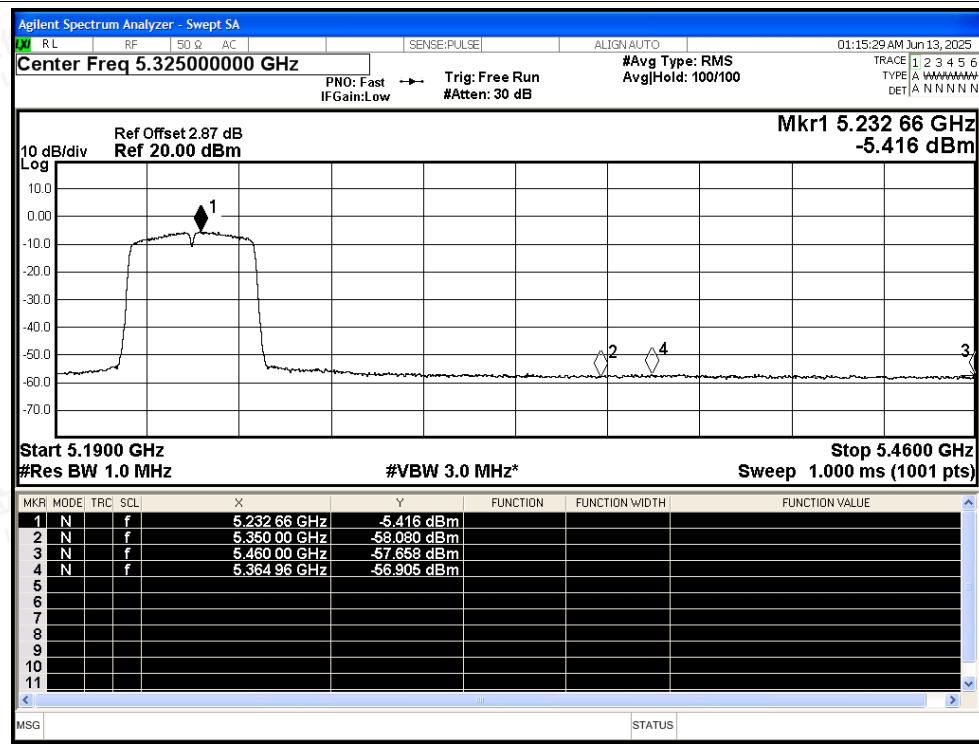

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5180MHz Ant2 Peak

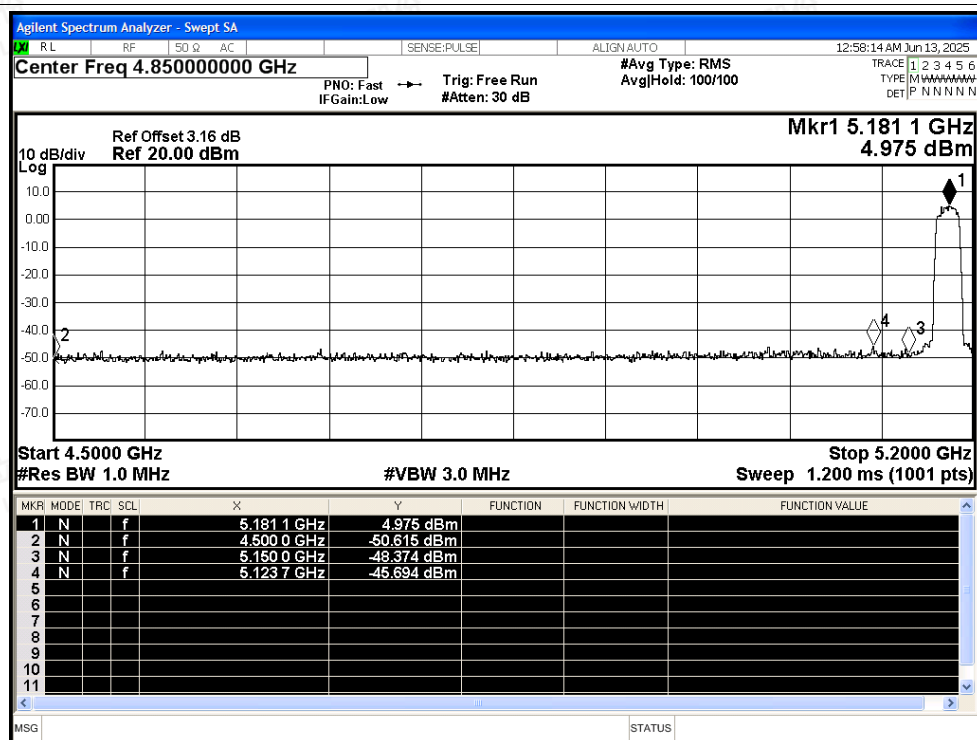

## Restrict Band NVNT ac20 5180MHz Ant2 Average

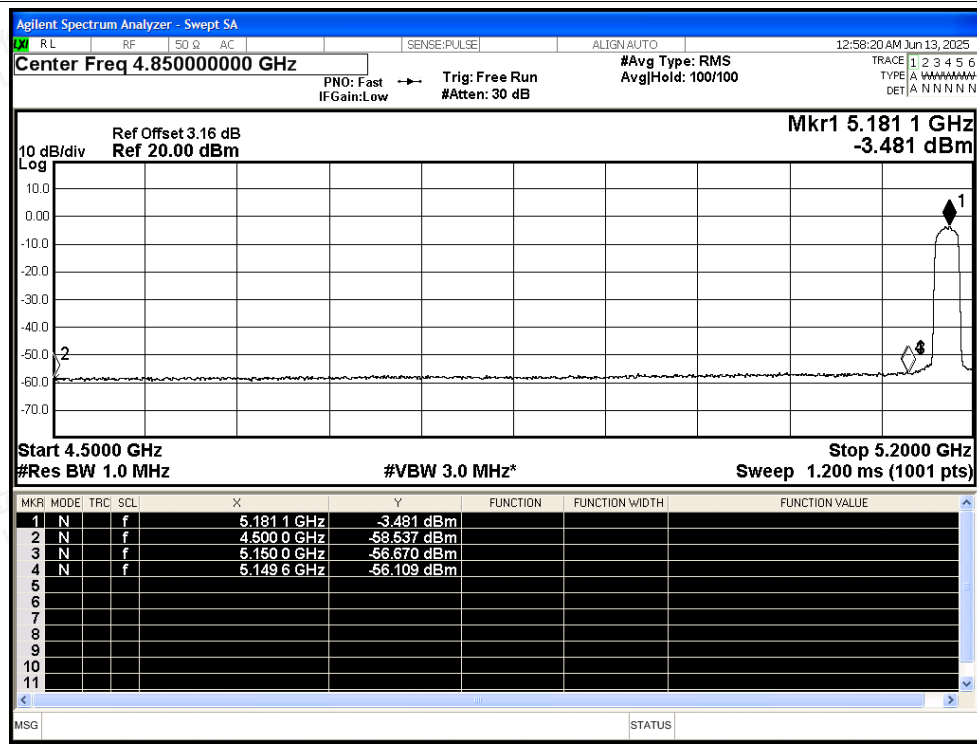

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5240MHz Ant2 Peak

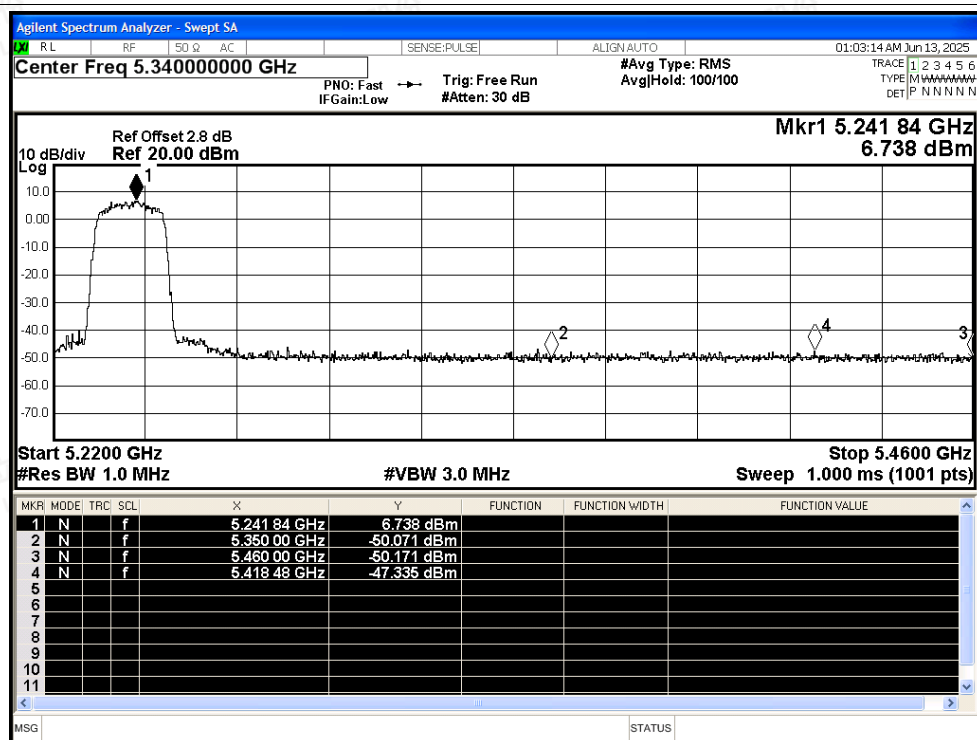

## Restrict Band NVNT ac20 5240MHz Ant2 Average

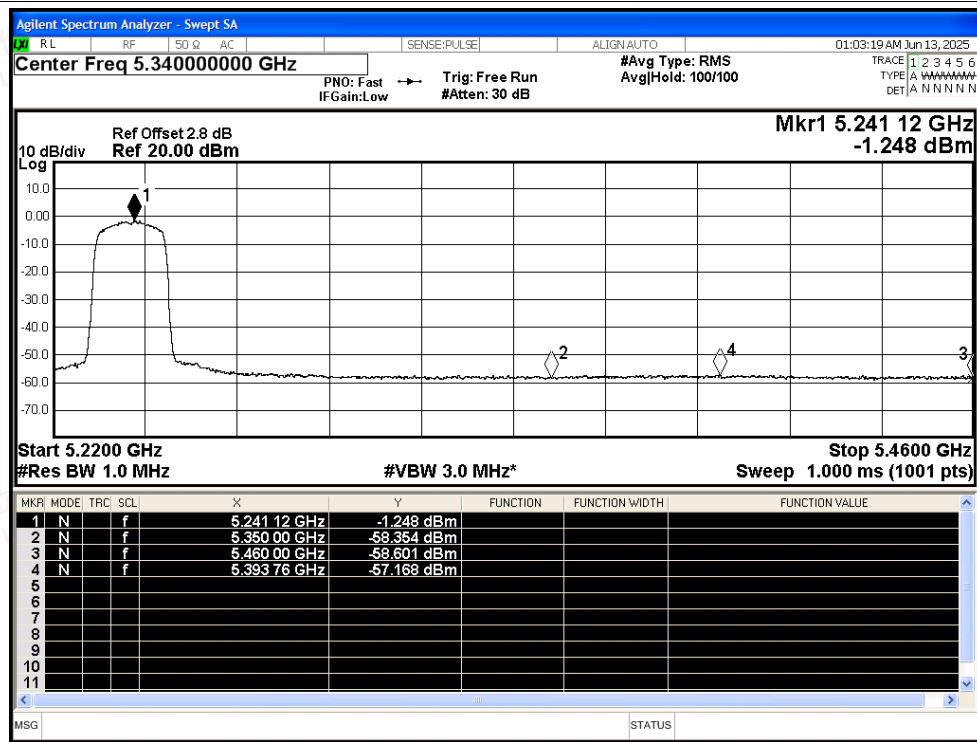

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5190MHz Ant2 Peak

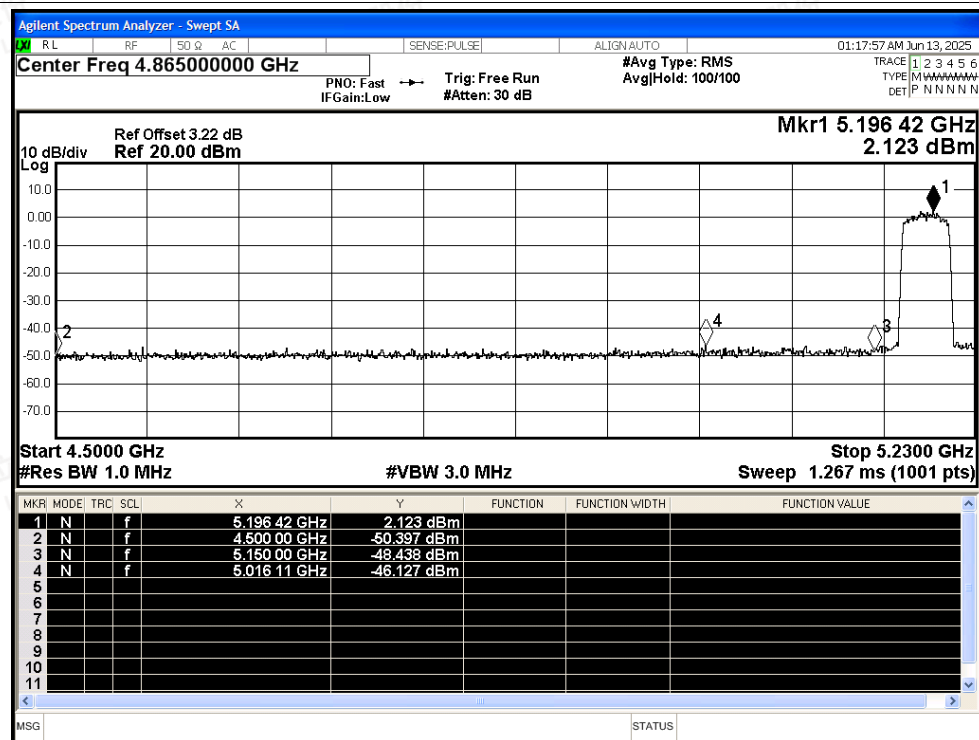

## Restrict Band NVNT ac40 5190MHz Ant2 Average

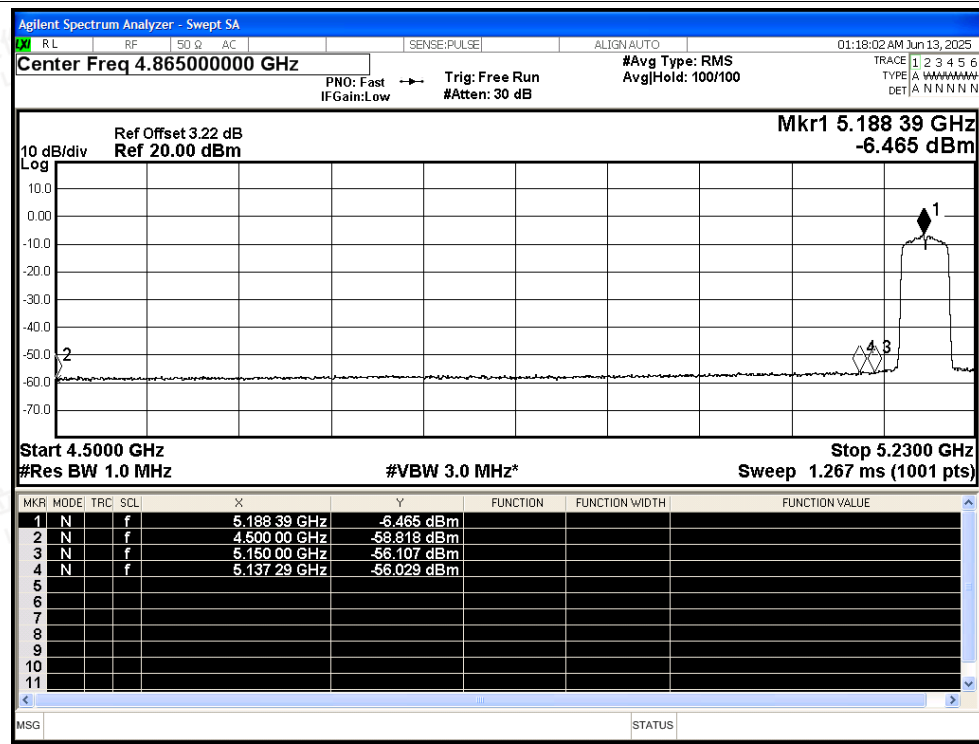

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5230MHz Ant2 Peak

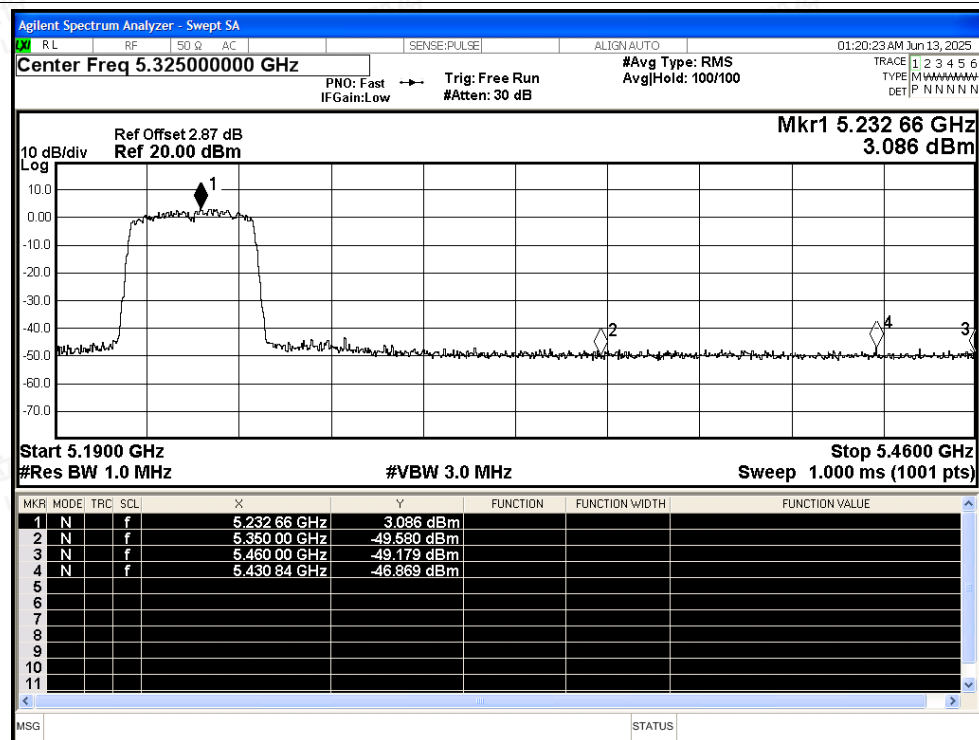

## Restrict Band NVNT ac40 5230MHz Ant2 Average

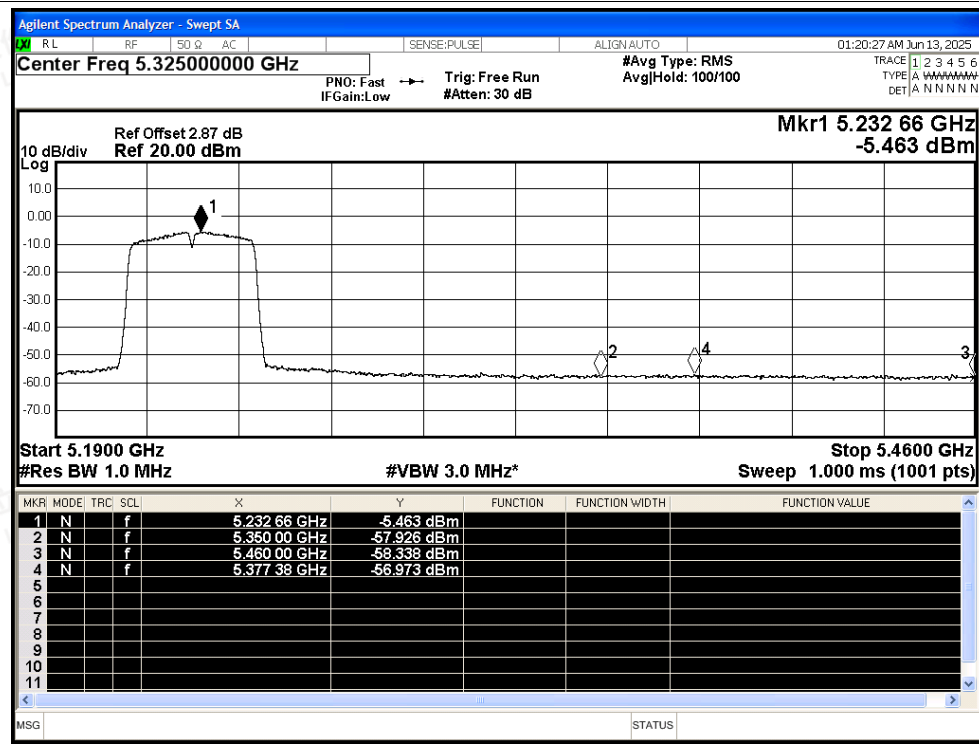

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5210MHz Ant2 Peak

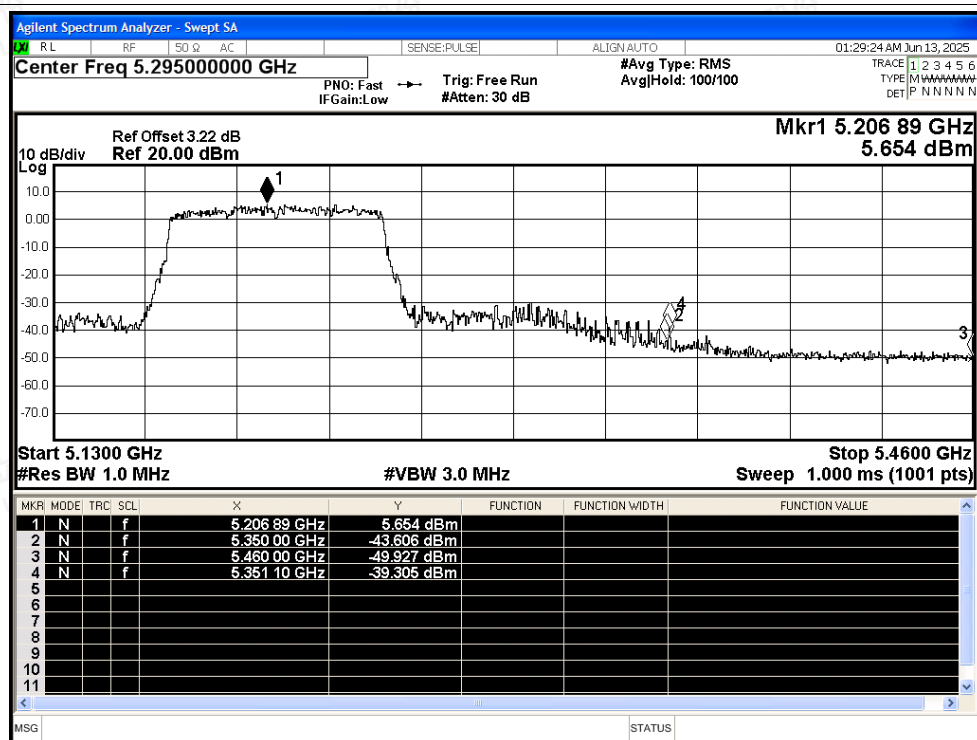

## Restrict Band NVNT ac80 5210MHz Ant2 Average

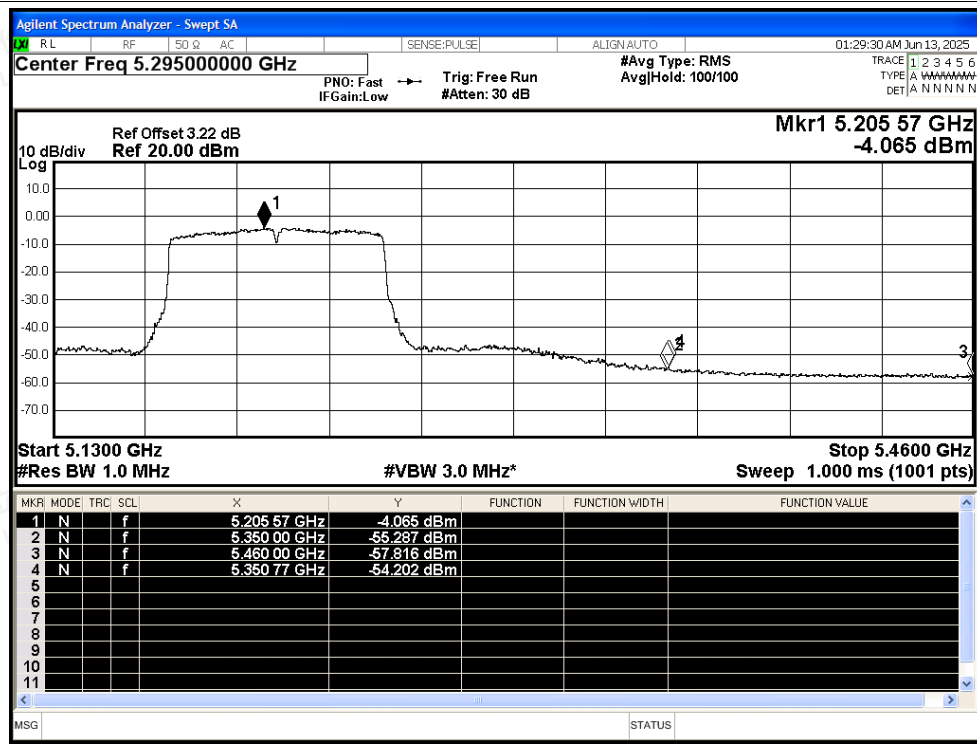

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5210MHz Ant2 Peak

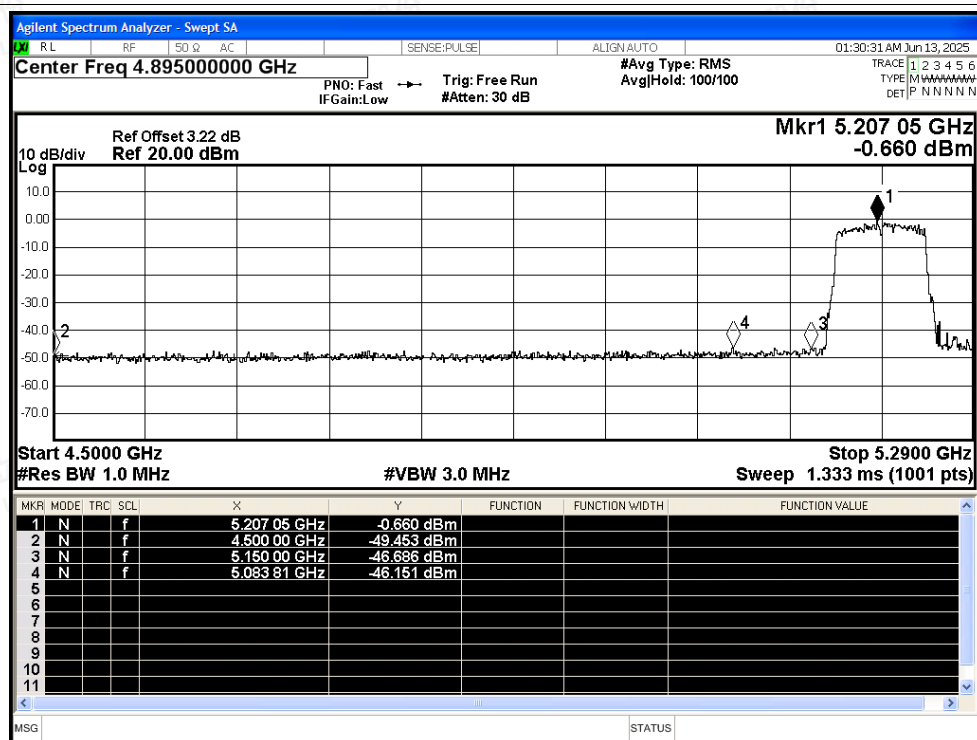

## Restrict Band NVNT ac80 5210MHz Ant2 Average

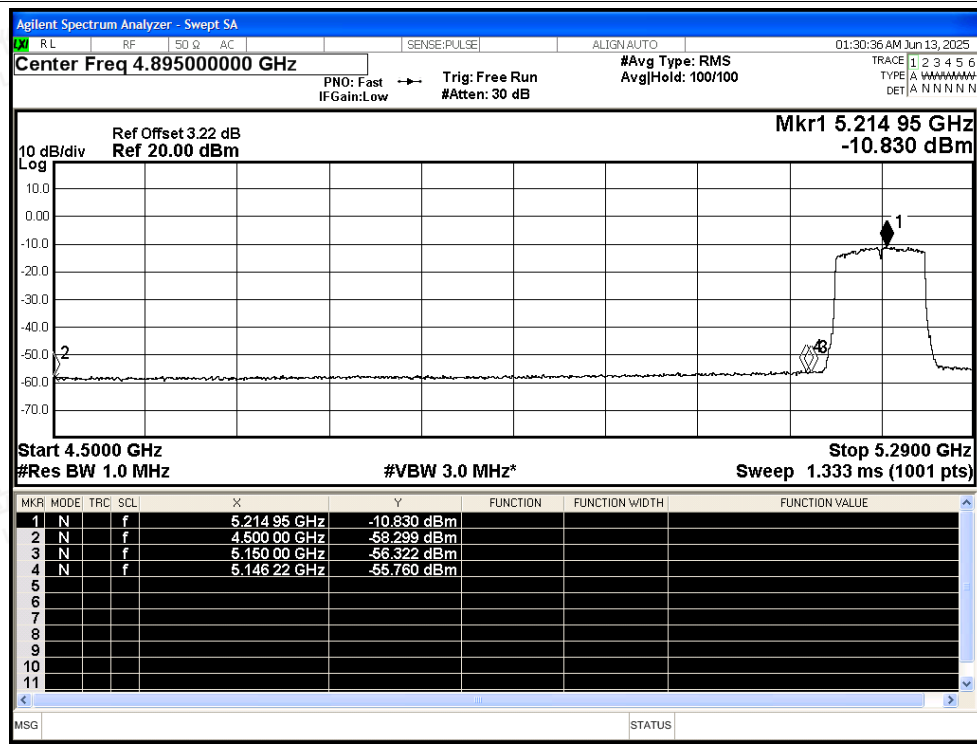

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5180MHz Ant2 Peak

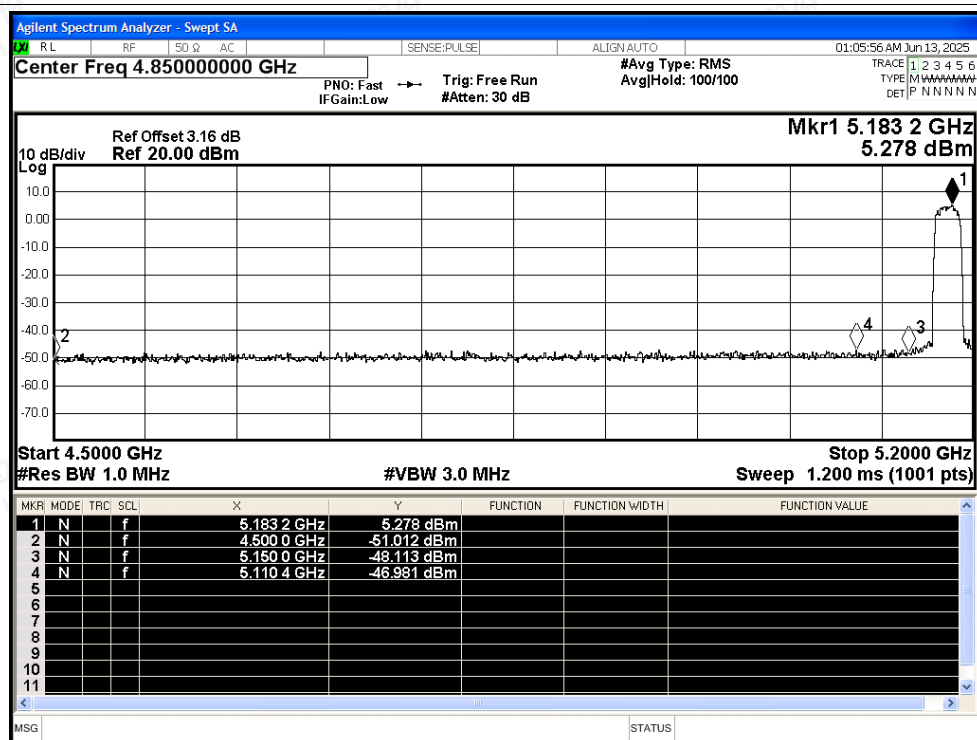

## Restrict Band NVNT ax20 5180MHz Ant2 Average

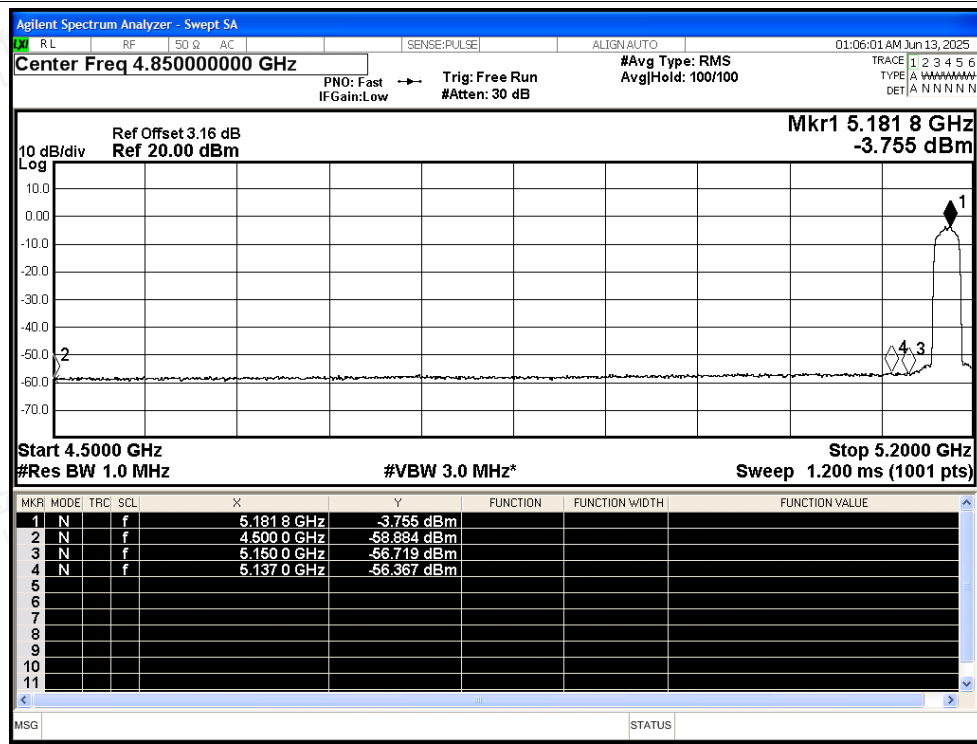

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5240MHz Ant2 Peak

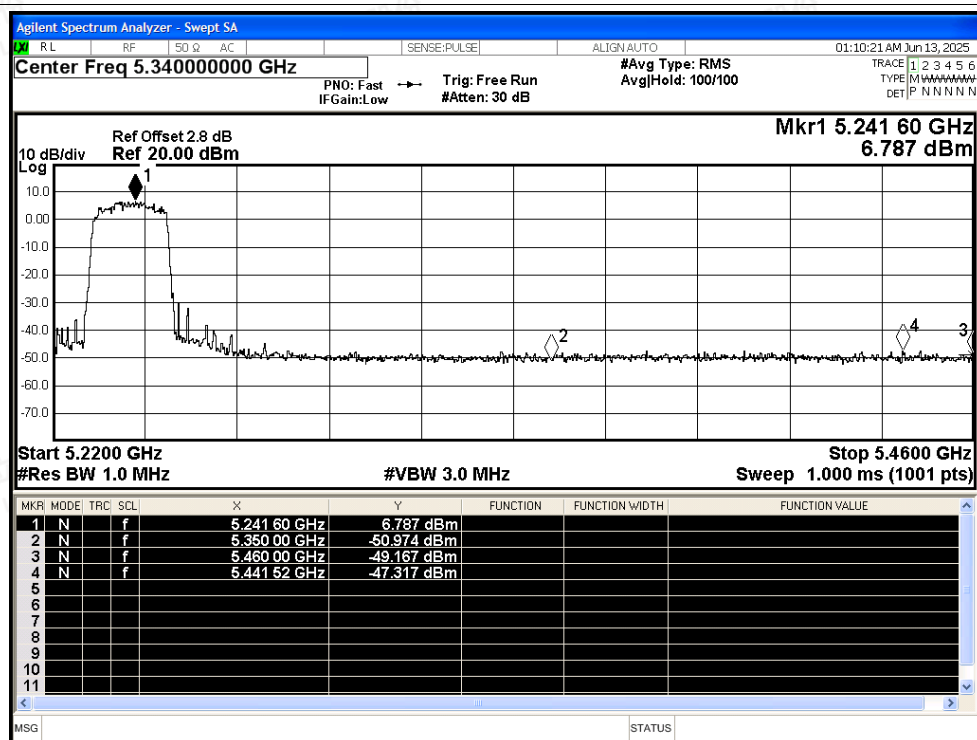

## Restrict Band NVNT ax20 5240MHz Ant2 Average

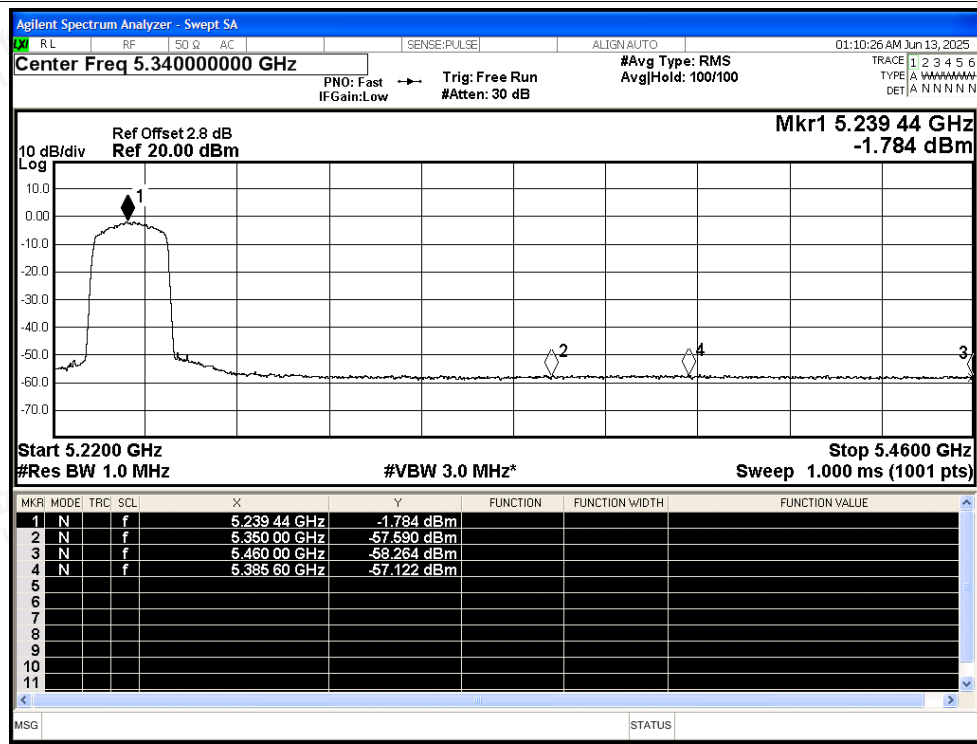

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5190MHz Ant2 Peak

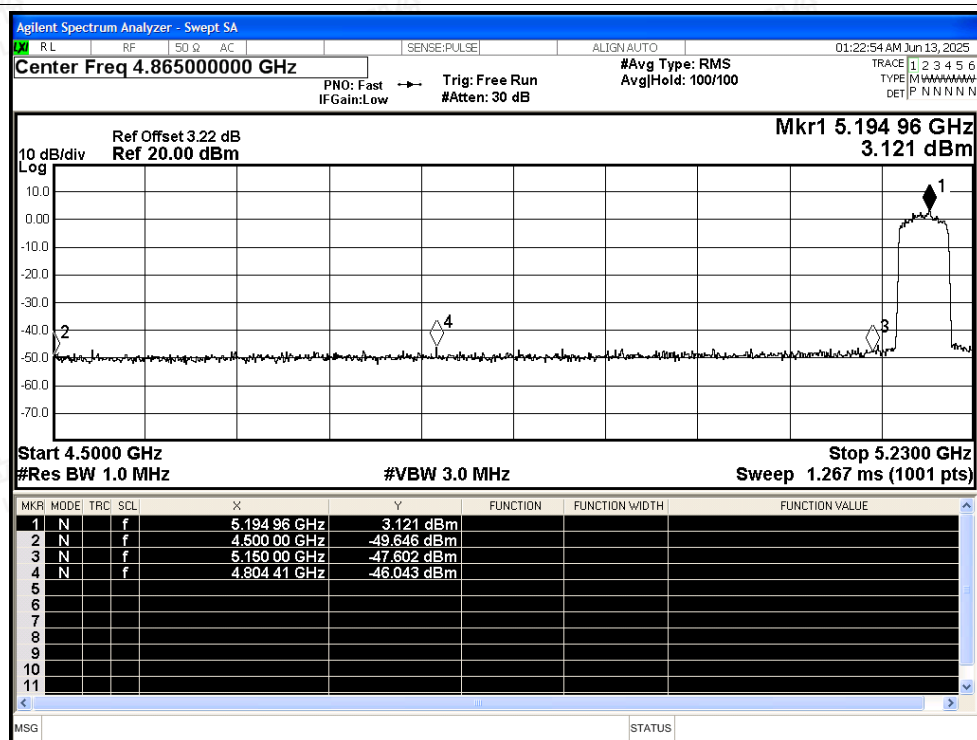

## Restrict Band NVNT ax40 5190MHz Ant2 Average

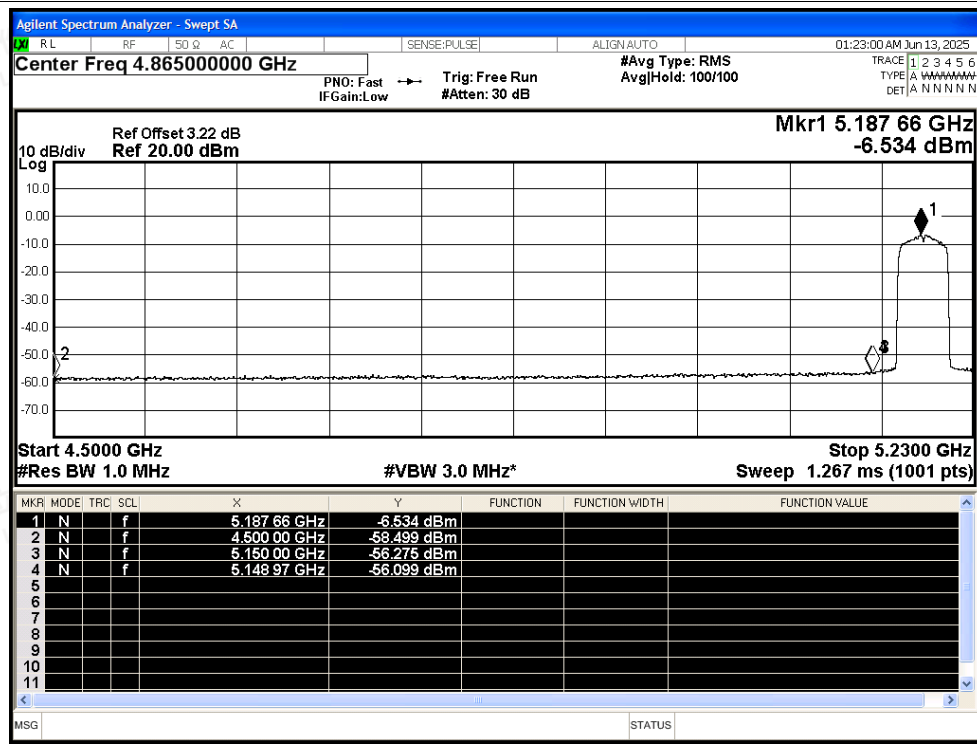

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5230MHz Ant2 Peak

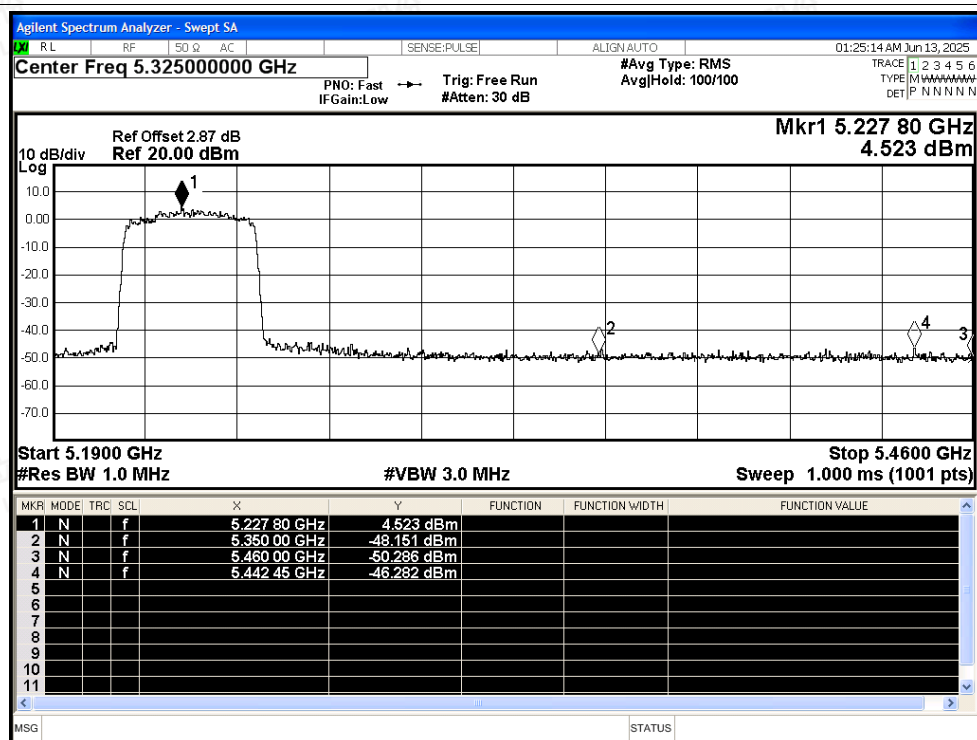

## Restrict Band NVNT ax40 5230MHz Ant2 Average

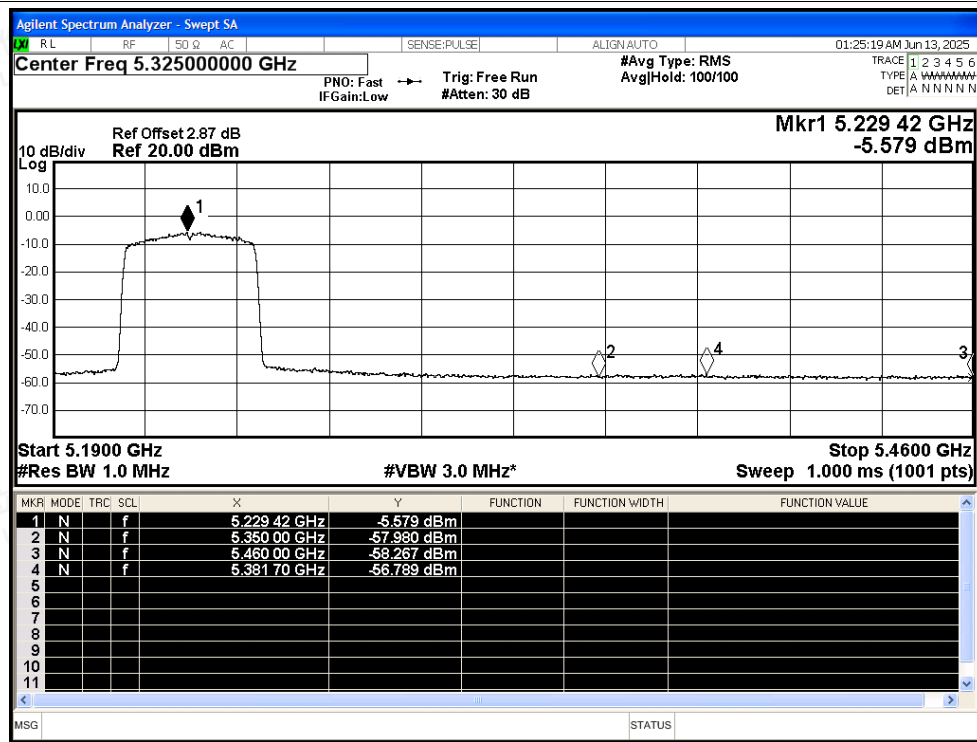

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5210MHz Ant2 Peak

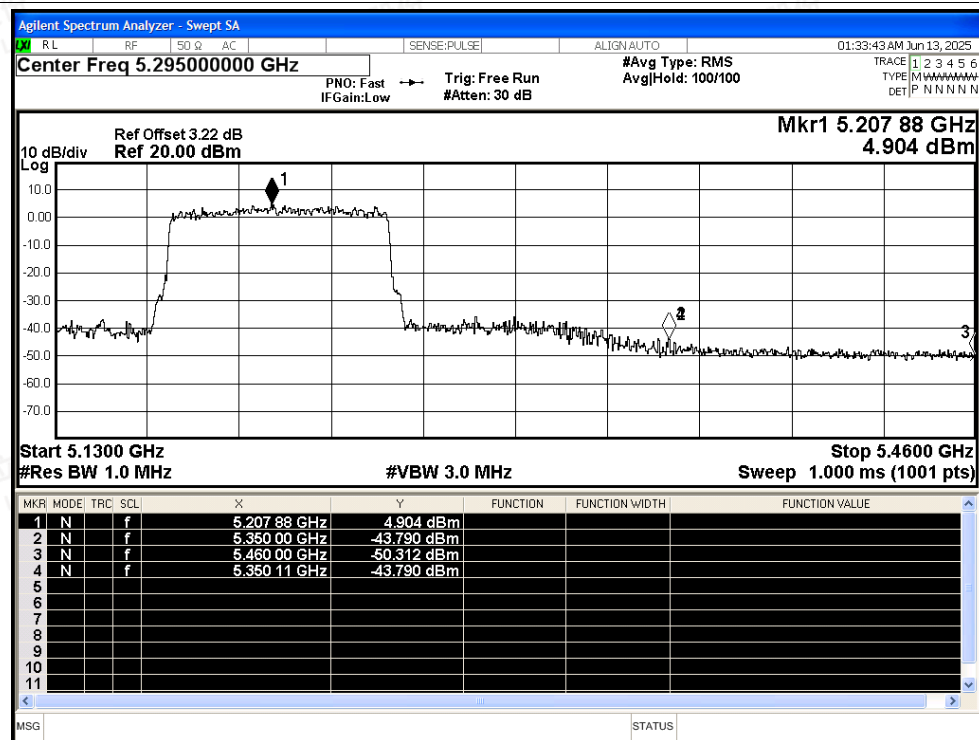

## Restrict Band NVNT ax80 5210MHz Ant2 Average

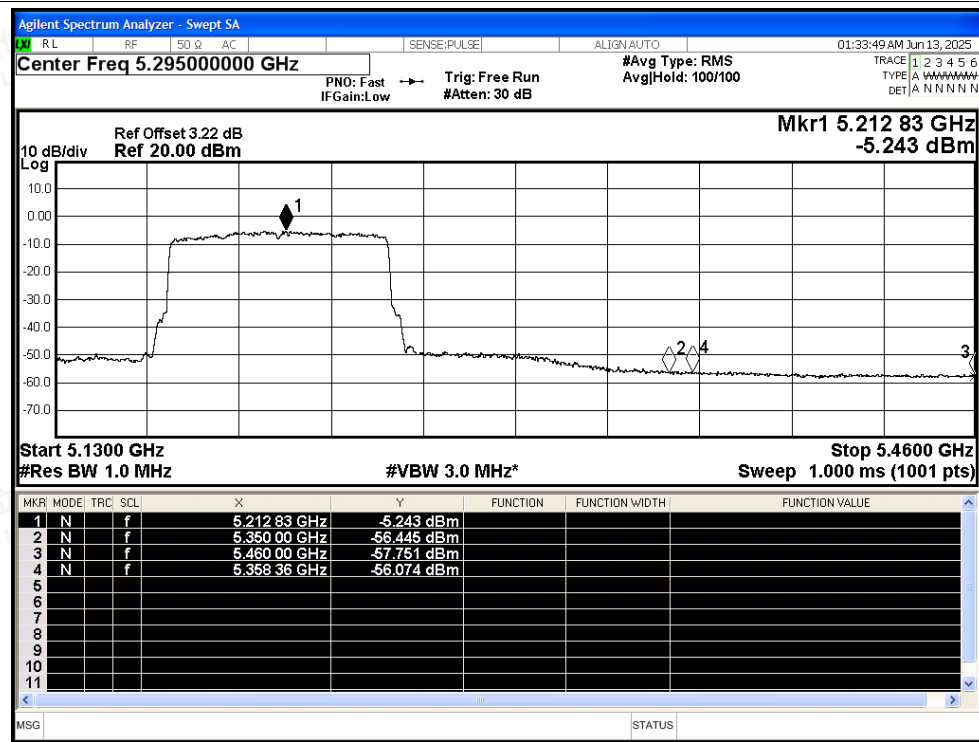

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5210MHz Ant2 Peak

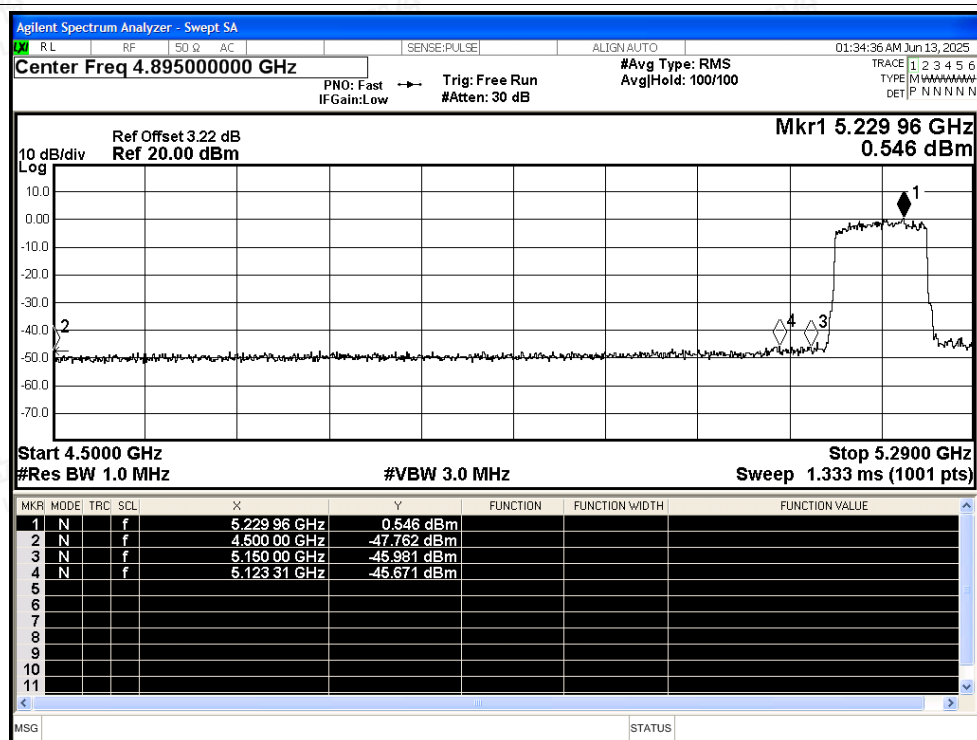

## Restrict Band NVNT ax80 5210MHz Ant2 Average

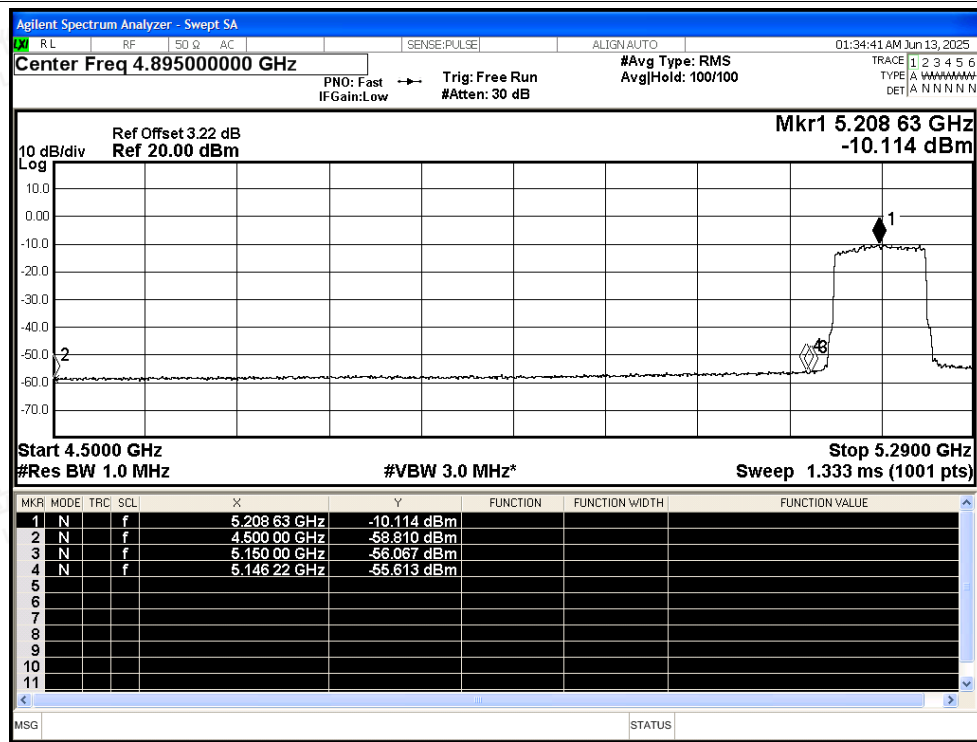

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

| Condition | Mode | Frequency<br>(MHz) | Ant1<br>Power<br>(dBm) | Ant2<br>Power<br>(dBm) | Sum<br>(Ant1+Ant2) | Gain (dBi) | Total<br>E<br>(dBuV/m) | Detector | Limit<br>(dBuV/m) | Verdict |
|-----------|------|--------------------|------------------------|------------------------|--------------------|------------|------------------------|----------|-------------------|---------|
| NVNT      | n20  | 5180               | -50.89                 | -51.03                 | -47.95             | 5.11       | 52.39                  | Peak     | 68.2              | PASS    |
| NVNT      | n20  | 5180               | -58.92                 | -58.92                 | -55.91             | 5.11       | 44.43                  | Average  | 54                | PASS    |
| NVNT      | n20  | 5180               | -46.59                 | -45.93                 | -43.24             | 5.11       | 57.10                  | Peak     | 68.2              | PASS    |
| NVNT      | n20  | 5180               | -56.26                 | -56.06                 | -53.15             | 5.11       | 47.19                  | Average  | 54                | PASS    |
| NVNT      | n20  | 5180               | -48.66                 | -48.46                 | -45.55             | 5.11       | 54.79                  | Peak     | 68.2              | PASS    |
| NVNT      | n20  | 5180               | -56.64                 | -56.71                 | -53.66             | 5.11       | 46.67                  | Average  | 54                | PASS    |
| NVNT      | n20  | 5240               | -49.69                 | -49.88                 | -46.77             | 5.11       | 53.56                  | Peak     | 68.2              | PASS    |
| NVNT      | n20  | 5240               | -58.35                 | -57.94                 | -55.13             | 5.11       | 45.21                  | Average  | 54                | PASS    |
| NVNT      | n20  | 5240               | -47.15                 | -47                    | -44.06             | 5.11       | 56.27                  | Peak     | 68.2              | PASS    |
| NVNT      | n20  | 5240               | -57.12                 | -57.16                 | -54.13             | 5.11       | 46.21                  | Average  | 54                | PASS    |
| NVNT      | n20  | 5240               | -49.3                  | -50.25                 | -46.74             | 5.11       | 53.60                  | Peak     | 68.2              | PASS    |
| NVNT      | n20  | 5240               | -58.2                  | -58.58                 | -55.38             | 5.11       | 44.96                  | Average  | 54                | PASS    |
| NVNT      | n40  | 5190               | -51.24                 | -50.02                 | -47.58             | 5.11       | 52.76                  | Peak     | 68.2              | PASS    |
| NVNT      | n40  | 5190               | -58.79                 | -58.84                 | -55.80             | 5.11       | 44.53                  | Average  | 54                | PASS    |
| NVNT      | n40  | 5190               | -46.9                  | -46.24                 | -43.55             | 5.11       | 56.79                  | Peak     | 68.2              | PASS    |
| NVNT      | n40  | 5190               | -55.94                 | -56.1                  | -53.01             | 5.11       | 47.33                  | Average  | 54                | PASS    |
| NVNT      | n40  | 5190               | -47.53                 | -47.92                 | -44.71             | 5.11       | 55.63                  | Peak     | 68.2              | PASS    |
| NVNT      | n40  | 5190               | -55.94                 | -56.19                 | -53.05             | 5.11       | 47.28                  | Average  | 54                | PASS    |
| NVNT      | n40  | 5230               | -49.72                 | -50.31                 | -46.99             | 5.11       | 53.34                  | Peak     | 68.2              | PASS    |
| NVNT      | n40  | 5230               | -57.39                 | -58.08                 | -54.71             | 5.11       | 45.63                  | Average  | 54                | PASS    |
| NVNT      | n40  | 5230               | -46.49                 | -46.31                 | -43.39             | 5.11       | 56.95                  | Peak     | 68.2              | PASS    |
| NVNT      | n40  | 5230               | -56.92                 | -56.91                 | -53.90             | 5.11       | 46.43                  | Average  | 54                | PASS    |
| NVNT      | n40  | 5230               | -50.63                 | -48.35                 | -46.33             | 5.11       | 54.01                  | Peak     | 68.2              | PASS    |
| NVNT      | n40  | 5230               | -58.74                 | -57.66                 | -55.16             | 5.11       | 45.18                  | Average  | 54                | PASS    |
| NVNT      | ac20 | 5180               | -50.13                 | -50.62                 | -47.36             | 5.11       | 52.98                  | Peak     | 68.2              | PASS    |
| NVNT      | ac20 | 5180               | -58.82                 | -58.54                 | -55.67             | 5.11       | 44.67                  | Average  | 54                | PASS    |
| NVNT      | ac20 | 5180               | -46.27                 | -45.69                 | -42.96             | 5.11       | 57.38                  | Peak     | 68.2              | PASS    |
| NVNT      | ac20 | 5180               | -56.46                 | -56.11                 | -53.27             | 5.11       | 47.07                  | Average  | 54                | PASS    |
| NVNT      | ac20 | 5180               | -47.14                 | -48.37                 | -44.70             | 5.11       | 55.64                  | Peak     | 68.2              | PASS    |
| NVNT      | ac20 | 5180               | -56.84                 | -56.67                 | -53.74             | 5.11       | 46.59                  | Average  | 54                | PASS    |
| NVNT      | ac20 | 5240               | -48                    | -50.07                 | -45.90             | 5.11       | 54.44                  | Peak     | 68.2              | PASS    |
| NVNT      | ac20 | 5240               | -58.17                 | -58.35                 | -55.25             | 5.11       | 45.09                  | Average  | 54                | PASS    |
| NVNT      | ac20 | 5240               | -46.73                 | -47.34                 | -44.01             | 5.11       | 56.32                  | Peak     | 68.2              | PASS    |
| NVNT      | ac20 | 5240               | -57.03                 | -57.17                 | -54.09             | 5.11       | 46.25                  | Average  | 54                | PASS    |
| NVNT      | ac20 | 5240               | -51.13                 | -50.17                 | -47.61             | 5.11       | 52.72                  | Peak     | 68.2              | PASS    |
| NVNT      | ac20 | 5240               | -58.15                 | -58.6                  | -55.36             | 5.11       | 44.98                  | Average  | 54                | PASS    |
| NVNT      | ac40 | 5190               | -51.94                 | -50.4                  | -48.09             | 5.11       | 52.25                  | Peak     | 68.2              | PASS    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |        |        |        |      |       |         |      |      |
|------|------|------|--------|--------|--------|------|-------|---------|------|------|
| NVNT | ac40 | 5190 | -58.48 | -58.82 | -55.64 | 5.11 | 44.70 | Average | 54   | PASS |
| NVNT | ac40 | 5190 | -46.14 | -46.13 | -43.12 | 5.11 | 57.21 | Peak    | 68.2 | PASS |
| NVNT | ac40 | 5190 | -56.06 | -56.03 | -53.03 | 5.11 | 47.30 | Average | 54   | PASS |
| NVNT | ac40 | 5190 | -47.84 | -48.44 | -45.12 | 5.11 | 55.22 | Peak    | 68.2 | PASS |
| NVNT | ac40 | 5190 | -56.06 | -56.11 | -53.07 | 5.11 | 47.26 | Average | 54   | PASS |
| NVNT | ac40 | 5230 | -49.96 | -49.58 | -46.76 | 5.11 | 53.58 | Peak    | 68.2 | PASS |
| NVNT | ac40 | 5230 | -58.01 | -57.93 | -54.96 | 5.11 | 45.38 | Average | 54   | PASS |
| NVNT | ac40 | 5230 | -46.94 | -46.87 | -43.89 | 5.11 | 56.44 | Peak    | 68.2 | PASS |
| NVNT | ac40 | 5230 | -56.91 | -56.97 | -53.93 | 5.11 | 46.41 | Average | 54   | PASS |
| NVNT | ac40 | 5230 | -48.35 | -49.18 | -45.73 | 5.11 | 54.60 | Peak    | 68.2 | PASS |
| NVNT | ac40 | 5230 | -58.03 | -58.34 | -55.17 | 5.11 | 45.17 | Average | 54   | PASS |
| NVNT | ac80 | 5210 | -42.64 | -43.61 | -40.09 | 5.11 | 60.25 | Peak    | 68.2 | PASS |
| NVNT | ac80 | 5210 | -55.73 | -55.29 | -52.49 | 5.11 | 47.84 | Average | 54   | PASS |
| NVNT | ac80 | 5210 | -40.3  | -39.31 | -36.77 | 5.11 | 63.57 | Peak    | 68.2 | PASS |
| NVNT | ac80 | 5210 | -54.17 | -54.2  | -51.17 | 5.11 | 49.16 | Average | 54   | PASS |
| NVNT | ac80 | 5210 | -48.48 | -49.93 | -46.13 | 5.11 | 54.20 | Peak    | 68.2 | PASS |
| NVNT | ac80 | 5210 | -57.93 | -57.82 | -54.86 | 5.11 | 45.47 | Average | 54   | PASS |
| NVNT | ac80 | 5210 | -49.32 | -49.45 | -46.37 | 5.11 | 53.96 | Peak    | 68.2 | PASS |
| NVNT | ac80 | 5210 | -58.75 | -58.3  | -55.51 | 5.11 | 44.83 | Average | 54   | PASS |
| NVNT | ac80 | 5210 | -46.23 | -46.15 | -43.18 | 5.11 | 57.16 | Peak    | 68.2 | PASS |
| NVNT | ac80 | 5210 | -55.84 | -55.76 | -52.79 | 5.11 | 47.55 | Average | 54   | PASS |
| NVNT | ac80 | 5210 | -48.77 | -46.69 | -44.60 | 5.11 | 55.74 | Peak    | 68.2 | PASS |
| NVNT | ac80 | 5210 | -56.33 | -56.32 | -53.31 | 5.11 | 47.02 | Average | 54   | PASS |
| NVNT | ax20 | 5180 | -49.47 | -51.01 | -47.16 | 5.11 | 53.18 | Peak    | 68.2 | PASS |
| NVNT | ax20 | 5180 | -58.56 | -58.88 | -55.71 | 5.11 | 44.63 | Average | 54   | PASS |
| NVNT | ax20 | 5180 | -46.48 | -46.98 | -43.71 | 5.11 | 56.63 | Peak    | 68.2 | PASS |
| NVNT | ax20 | 5180 | -56.12 | -56.37 | -53.23 | 5.11 | 47.10 | Average | 54   | PASS |
| NVNT | ax20 | 5180 | -48.3  | -48.11 | -45.19 | 5.11 | 55.14 | Peak    | 68.2 | PASS |
| NVNT | ax20 | 5180 | -57.04 | -56.72 | -53.87 | 5.11 | 46.47 | Average | 54   | PASS |
| NVNT | ax20 | 5240 | -50.71 | -50.97 | -47.83 | 5.11 | 52.51 | Peak    | 68.2 | PASS |
| NVNT | ax20 | 5240 | -58.75 | -57.59 | -55.12 | 5.11 | 45.22 | Average | 54   | PASS |
| NVNT | ax20 | 5240 | -46.8  | -47.32 | -44.04 | 5.11 | 56.30 | Peak    | 68.2 | PASS |
| NVNT | ax20 | 5240 | -57.08 | -57.12 | -54.09 | 5.11 | 46.25 | Average | 54   | PASS |
| NVNT | ax20 | 5240 | -51.3  | -49.17 | -47.10 | 5.11 | 53.24 | Peak    | 68.2 | PASS |
| NVNT | ax20 | 5240 | -58.09 | -58.26 | -55.16 | 5.11 | 45.17 | Average | 54   | PASS |
| NVNT | ax40 | 5190 | -48.03 | -49.65 | -45.75 | 5.11 | 54.58 | Peak    | 68.2 | PASS |
| NVNT | ax40 | 5190 | -58.34 | -58.5  | -55.41 | 5.11 | 44.93 | Average | 54   | PASS |
| NVNT | ax40 | 5190 | -45.14 | -46.04 | -42.56 | 5.11 | 57.78 | Peak    | 68.2 | PASS |
| NVNT | ax40 | 5190 | -56.18 | -56.1  | -53.13 | 5.11 | 47.21 | Average | 54   | PASS |
| NVNT | ax40 | 5190 | -48.85 | -47.6  | -45.17 | 5.11 | 55.17 | Peak    | 68.2 | PASS |
| NVNT | ax40 | 5190 | -56.21 | -56.28 | -53.23 | 5.11 | 47.10 | Average | 54   | PASS |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |        |        |        |      |       |         |      |      |
|------|------|------|--------|--------|--------|------|-------|---------|------|------|
| NVNT | ax40 | 5230 | -49.57 | -48.15 | -45.79 | 5.11 | 54.55 | Peak    | 68.2 | PASS |
| NVNT | ax40 | 5230 | -57.34 | -57.98 | -54.64 | 5.11 | 45.70 | Average | 54   | PASS |
| NVNT | ax40 | 5230 | -46.91 | -46.28 | -43.57 | 5.11 | 56.76 | Peak    | 68.2 | PASS |
| NVNT | ax40 | 5230 | -56.99 | -56.79 | -53.88 | 5.11 | 46.46 | Average | 54   | PASS |
| NVNT | ax40 | 5230 | -48.94 | -50.29 | -46.55 | 5.11 | 53.79 | Peak    | 68.2 | PASS |
| NVNT | ax40 | 5230 | -58.7  | -58.27 | -55.47 | 5.11 | 44.87 | Average | 54   | PASS |
| NVNT | ax80 | 5210 | -46.24 | -43.79 | -41.83 | 5.11 | 58.50 | Peak    | 68.2 | PASS |
| NVNT | ax80 | 5210 | -55.11 | -56.45 | -52.72 | 5.11 | 47.62 | Average | 54   | PASS |
| NVNT | ax80 | 5210 | -41.04 | -43.79 | -39.19 | 5.11 | 61.15 | Peak    | 68.2 | PASS |
| NVNT | ax80 | 5210 | -55.08 | -56.07 | -52.54 | 5.11 | 47.80 | Average | 54   | PASS |
| NVNT | ax80 | 5210 | -47.9  | -50.31 | -45.93 | 5.11 | 54.41 | Peak    | 68.2 | PASS |
| NVNT | ax80 | 5210 | -57.32 | -57.75 | -54.52 | 5.11 | 45.82 | Average | 54   | PASS |
| NVNT | ax80 | 5210 | -49.27 | -47.76 | -45.44 | 5.11 | 54.90 | Peak    | 68.2 | PASS |
| NVNT | ax80 | 5210 | -58.69 | -58.81 | -55.74 | 5.11 | 44.60 | Average | 54   | PASS |
| NVNT | ax80 | 5210 | -35.62 | -45.67 | -35.21 | 5.11 | 65.13 | Peak    | 68.2 | PASS |
| NVNT | ax80 | 5210 | -55.88 | -55.61 | -52.73 | 5.11 | 47.60 | Average | 54   | PASS |
| NVNT | ax80 | 5210 | -47.28 | -45.98 | -43.57 | 5.11 | 56.77 | Peak    | 68.2 | PASS |
| NVNT | ax80 | 5210 | -56.3  | -56.07 | -53.17 | 5.11 | 47.16 | Average | 54   | PASS |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## D.5 Frequency Stability


| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5180            | Ant1    | 5179.92                  | -80000               | -15.44          | 25          | Pass    |
| NVNT      | a    | 5200            | Ant1    | 5199.92                  | -80000               | -15.38          | 25          | Pass    |
| NVNT      | a    | 5240            | Ant1    | 5239.92                  | -80000               | -15.27          | 25          | Pass    |
| NVNT      | n20  | 5180            | Ant1    | 5179.94                  | -60000               | -11.58          | 25          | Pass    |
| NVNT      | n20  | 5200            | Ant1    | 5199.9                   | -100000              | -19.23          | 25          | Pass    |
| NVNT      | n20  | 5240            | Ant1    | 5239.94                  | -60000               | -11.45          | 25          | Pass    |
| NVNT      | n40  | 5190            | Ant1    | 5189.96                  | -40000               | -7.71           | 25          | Pass    |
| NVNT      | n40  | 5230            | Ant1    | 5229.96                  | -40000               | -7.65           | 25          | Pass    |
| NVNT      | ac20 | 5180            | Ant1    | 5179.94                  | -60000               | -11.58          | 25          | Pass    |
| NVNT      | ac20 | 5200            | Ant1    | 5199.9                   | -100000              | -19.23          | 25          | Pass    |
| NVNT      | ac20 | 5240            | Ant1    | 5239.92                  | -80000               | -15.27          | 25          | Pass    |
| NVNT      | ac40 | 5190            | Ant1    | 5189.96                  | -40000               | -7.71           | 25          | Pass    |
| NVNT      | ac40 | 5230            | Ant1    | 5229.92                  | -80000               | -15.3           | 25          | Pass    |
| NVNT      | ac80 | 5210            | Ant1    | 5210                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5180            | Ant1    | 5179.92                  | -80000               | -15.44          | 25          | Pass    |
| NVNT      | ax20 | 5200            | Ant1    | 5199.92                  | -80000               | -15.38          | 25          | Pass    |
| NVNT      | ax20 | 5240            | Ant1    | 5239.92                  | -80000               | -15.27          | 25          | Pass    |
| NVNT      | ax40 | 5190            | Ant1    | 5189.88                  | -120000              | -23.12          | 25          | Pass    |
| NVNT      | ax40 | 5230            | Ant1    | 5229.88                  | -120000              | -22.94          | 25          | Pass    |
| NVNT      | ax80 | 5210            | Ant1    | 5209.92                  | -80000               | -15.36          | 25          | Pass    |






## Test Graphs

## Freq. Stability NVNT a 5180MHz Ant1

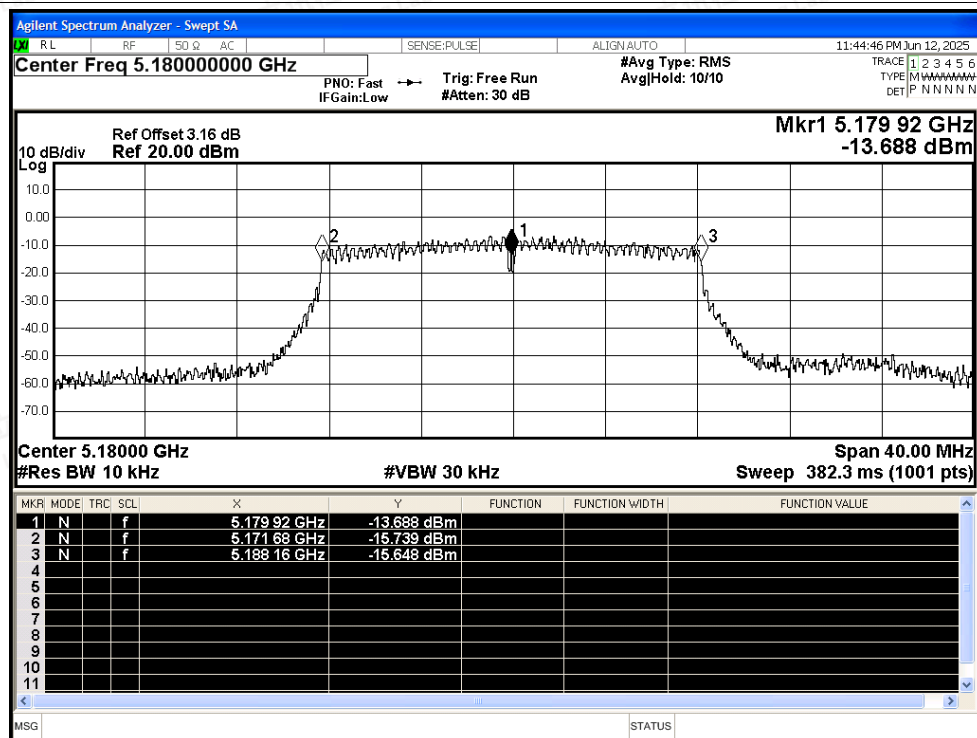

## Freq. Stability NVNT a 5200MHz Ant1

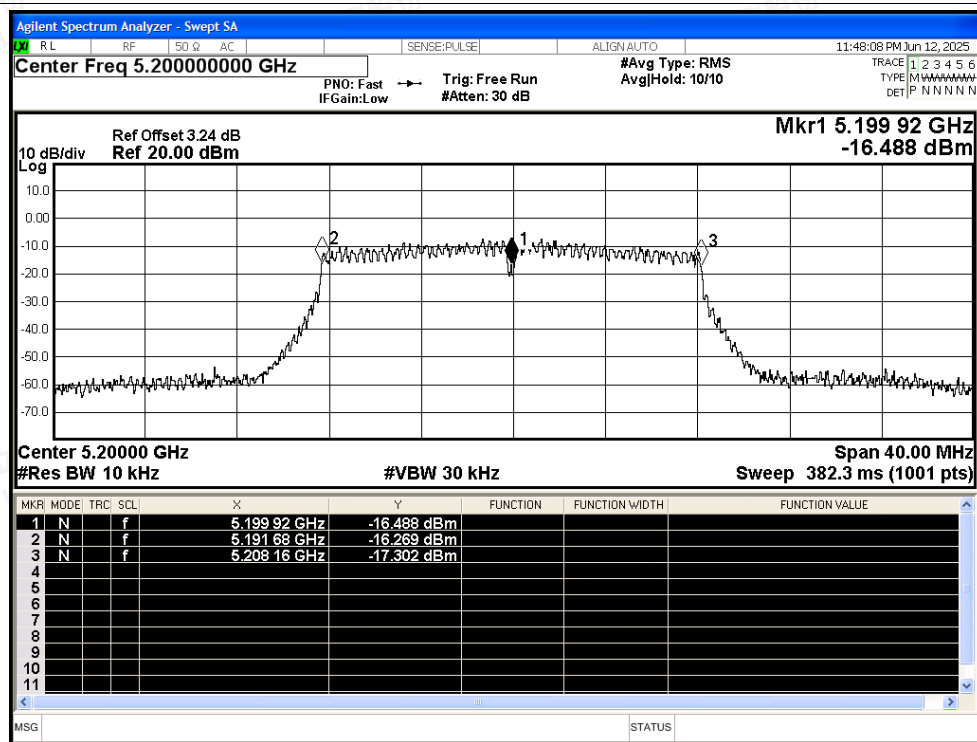

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT a 5240MHz Ant1

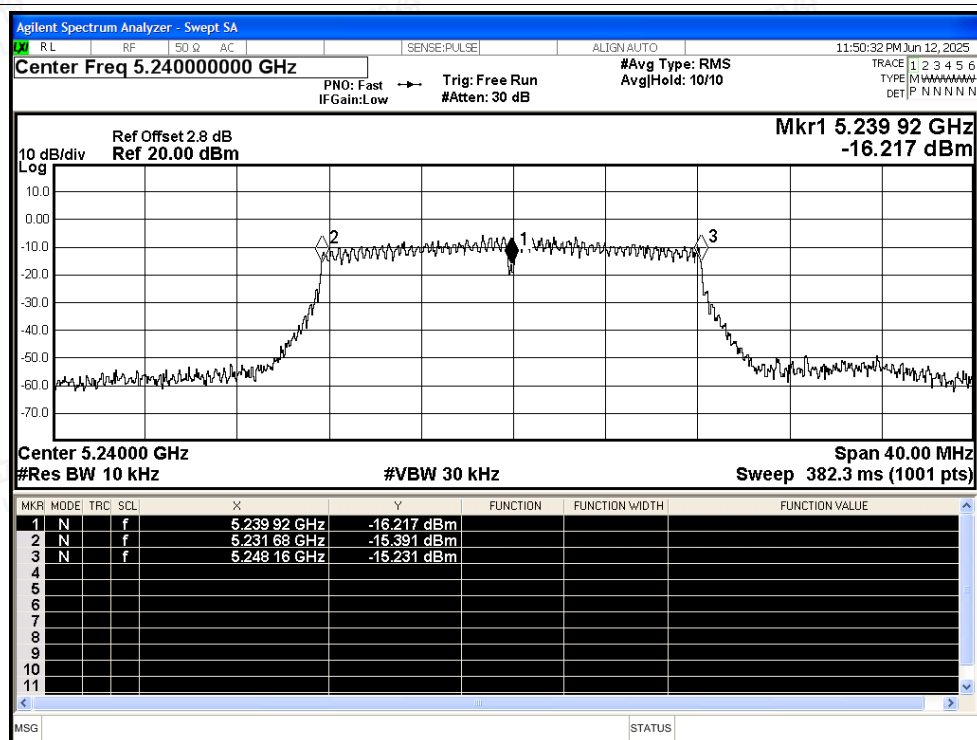

## Freq. Stability NVNT n20 5180MHz Ant1

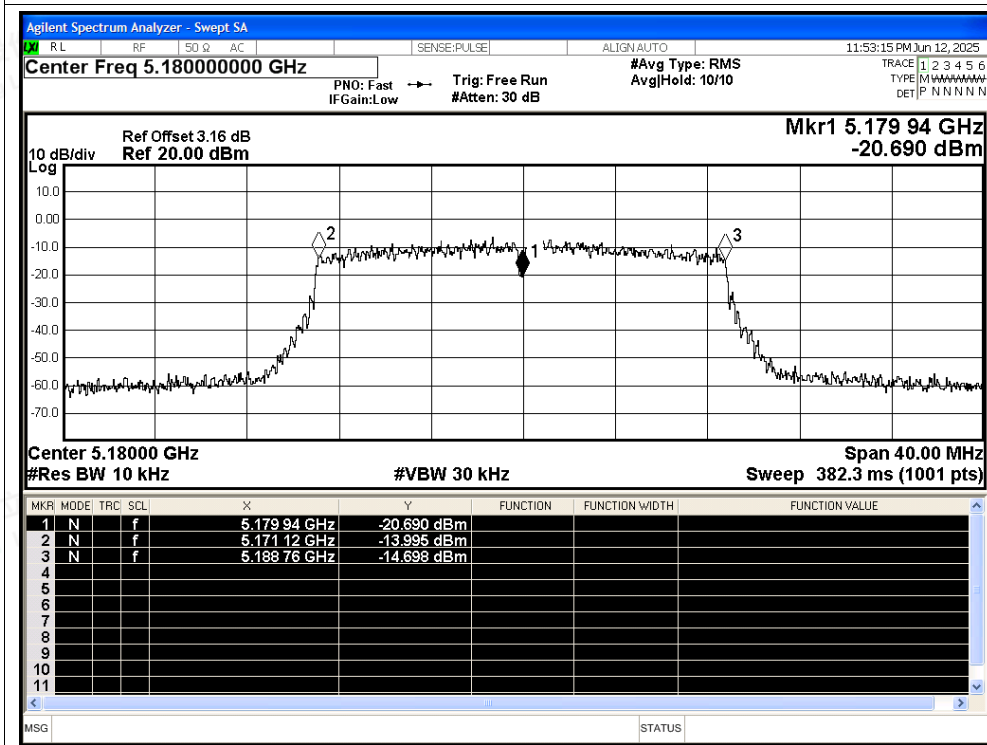

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n20 5200MHz Ant1

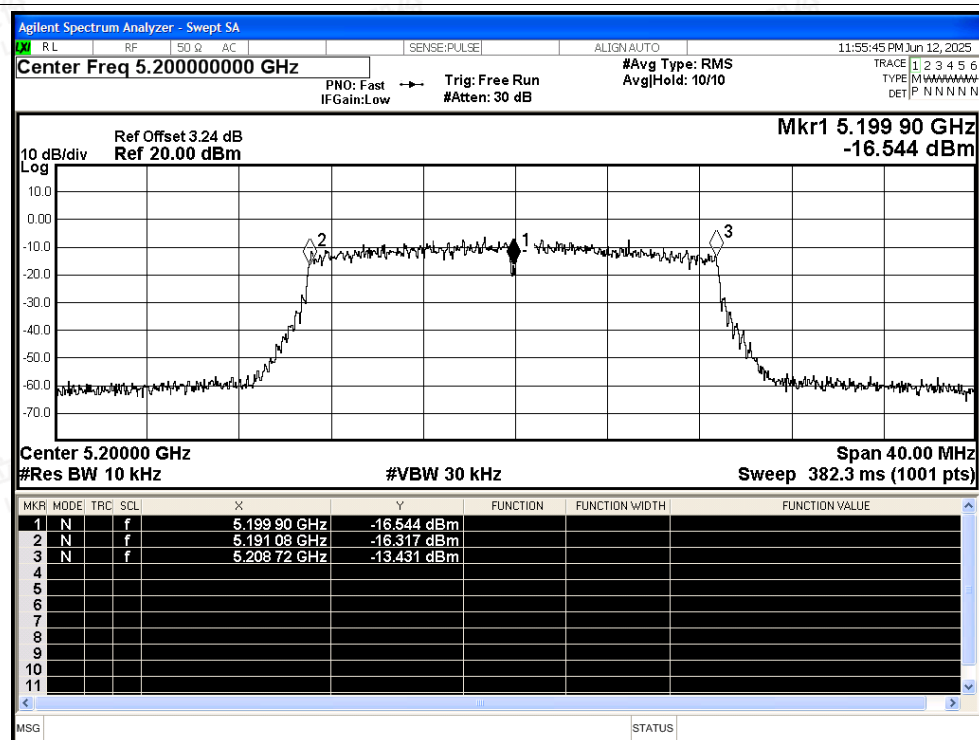

## Freq. Stability NVNT n20 5240MHz Ant1

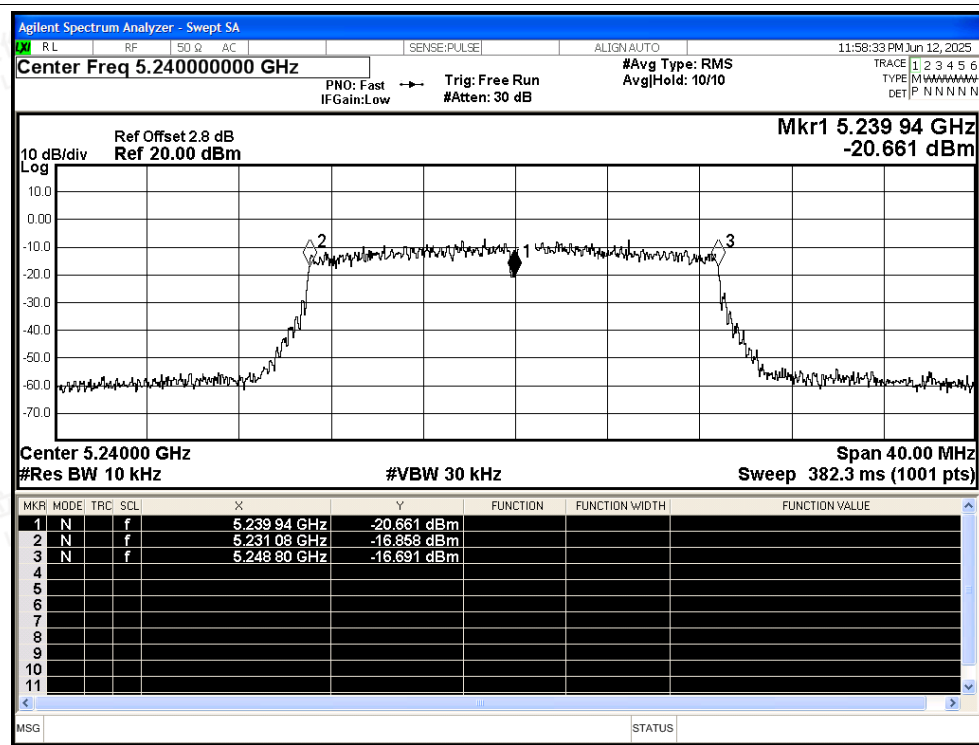

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5190MHz Ant1

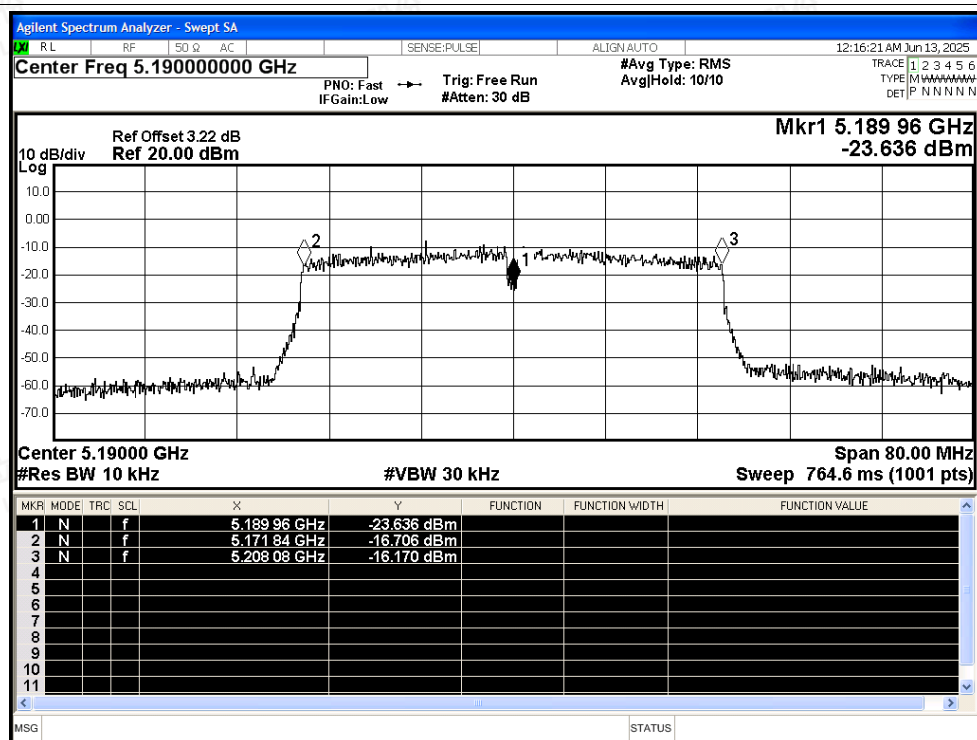

## Freq. Stability NVNT n40 5230MHz Ant1

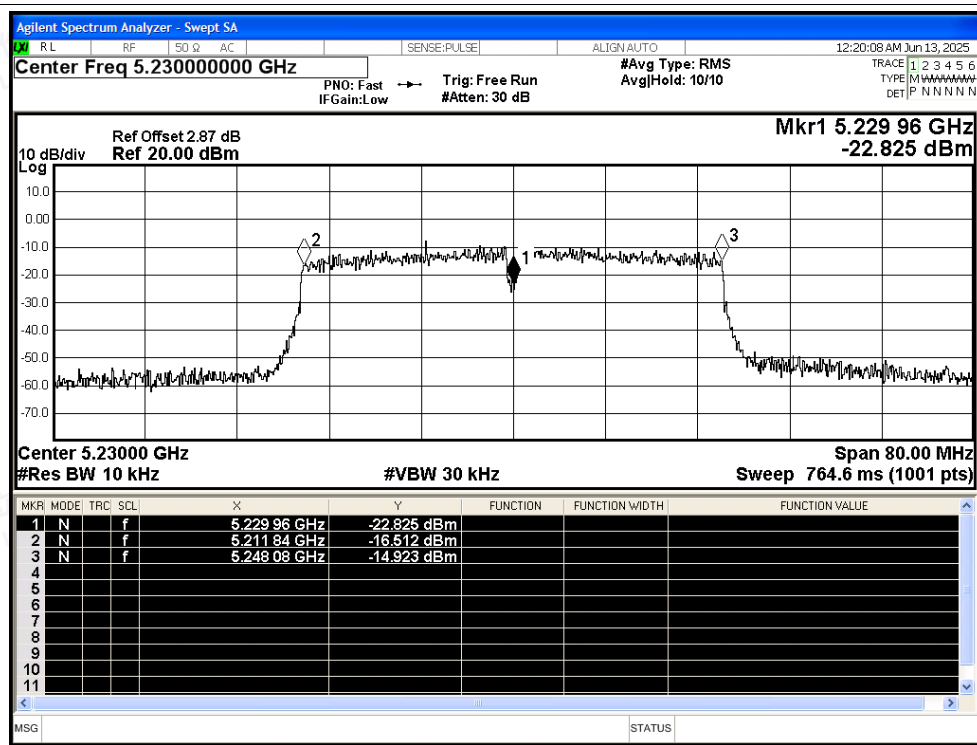

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5180MHz Ant1

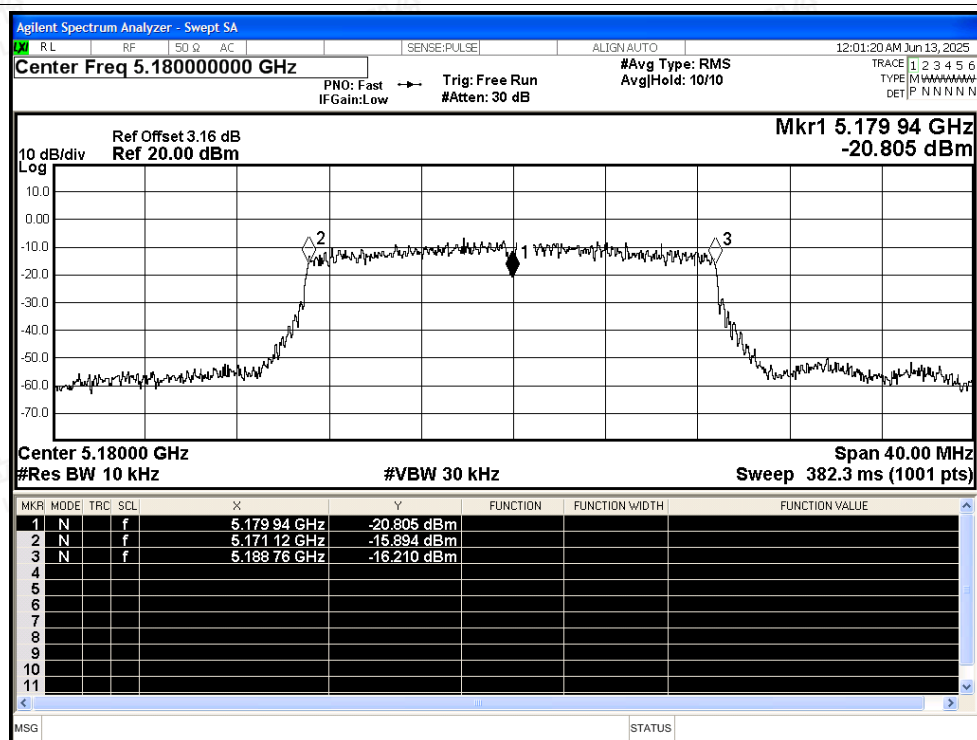

## Freq. Stability NVNT ac20 5200MHz Ant1

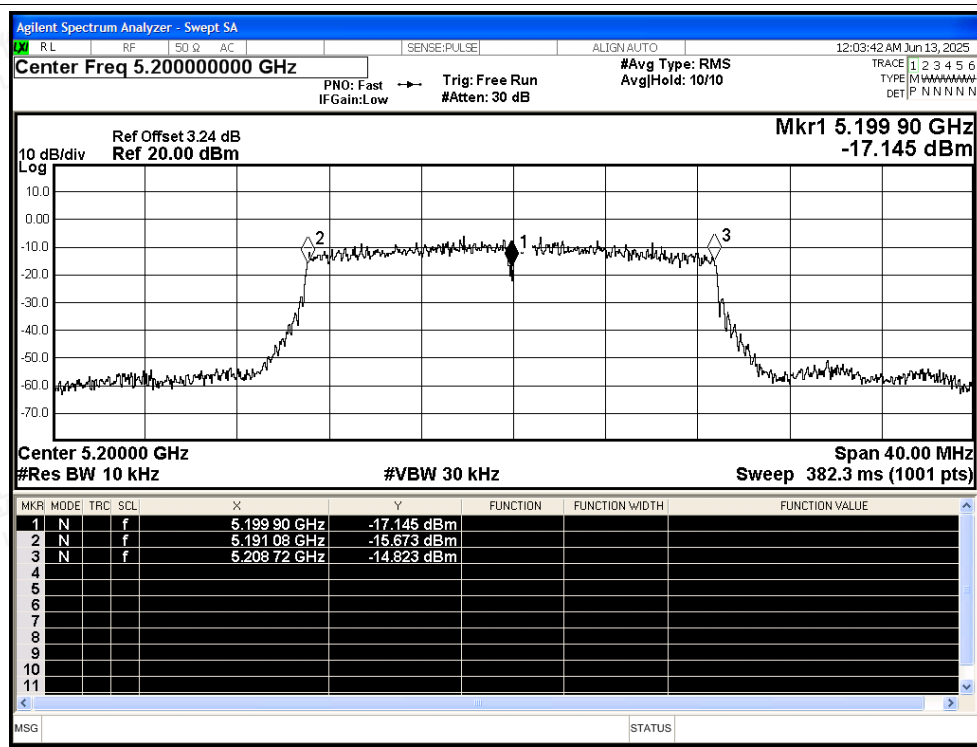

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5240MHz Ant1

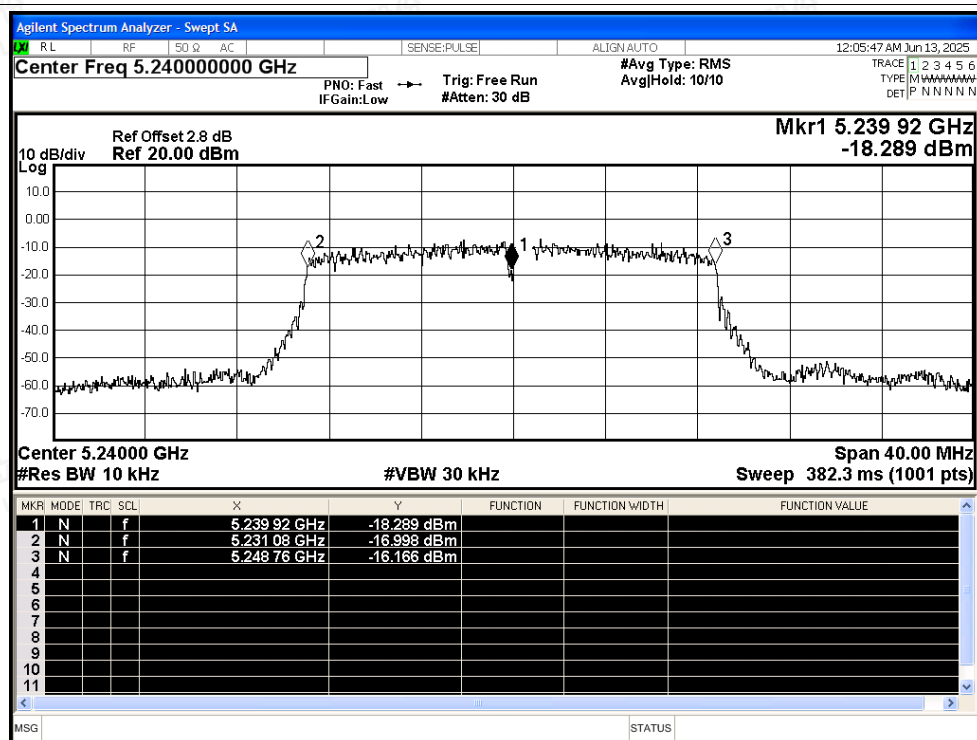

## Freq. Stability NVNT ac40 5190MHz Ant1

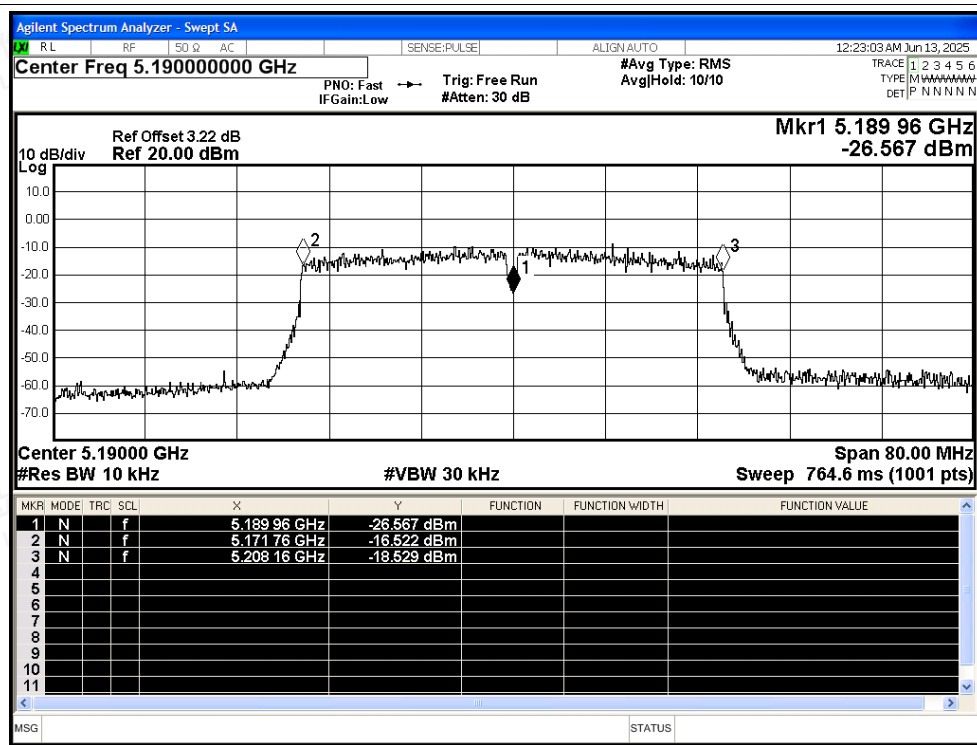

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac40 5230MHz Ant1

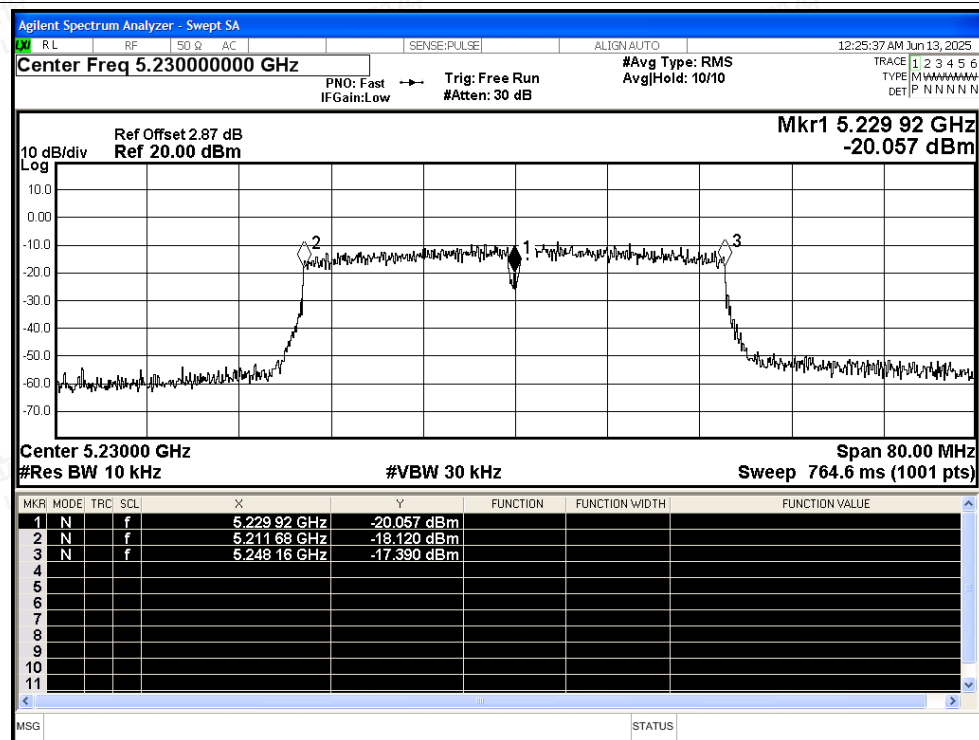

## Freq. Stability NVNT ac80 5210MHz Ant1

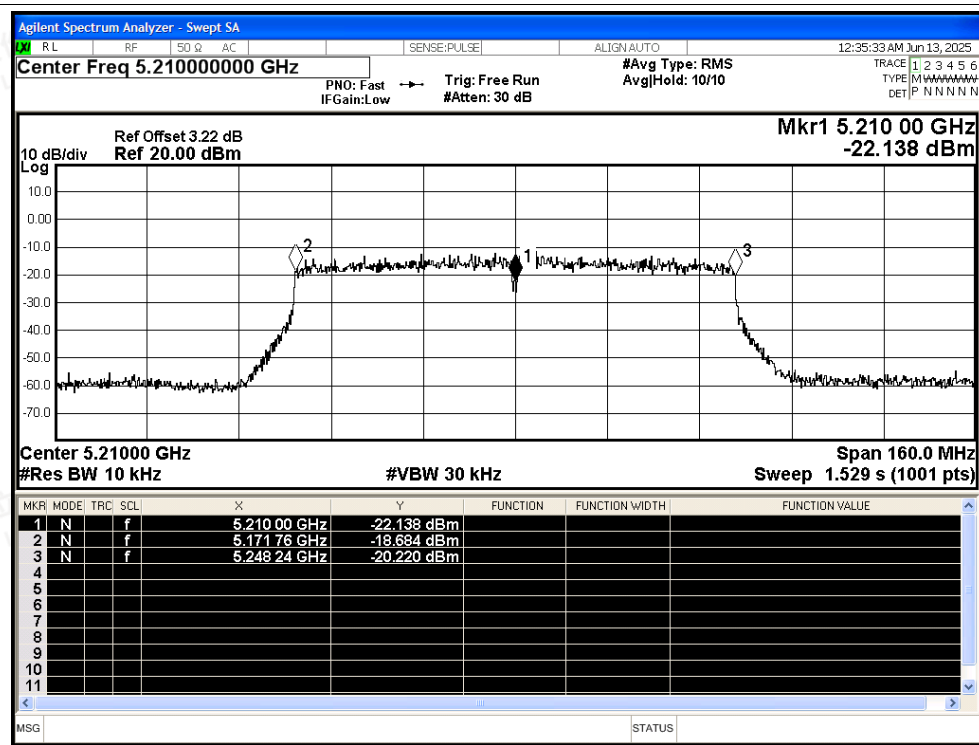

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5180MHz Ant1

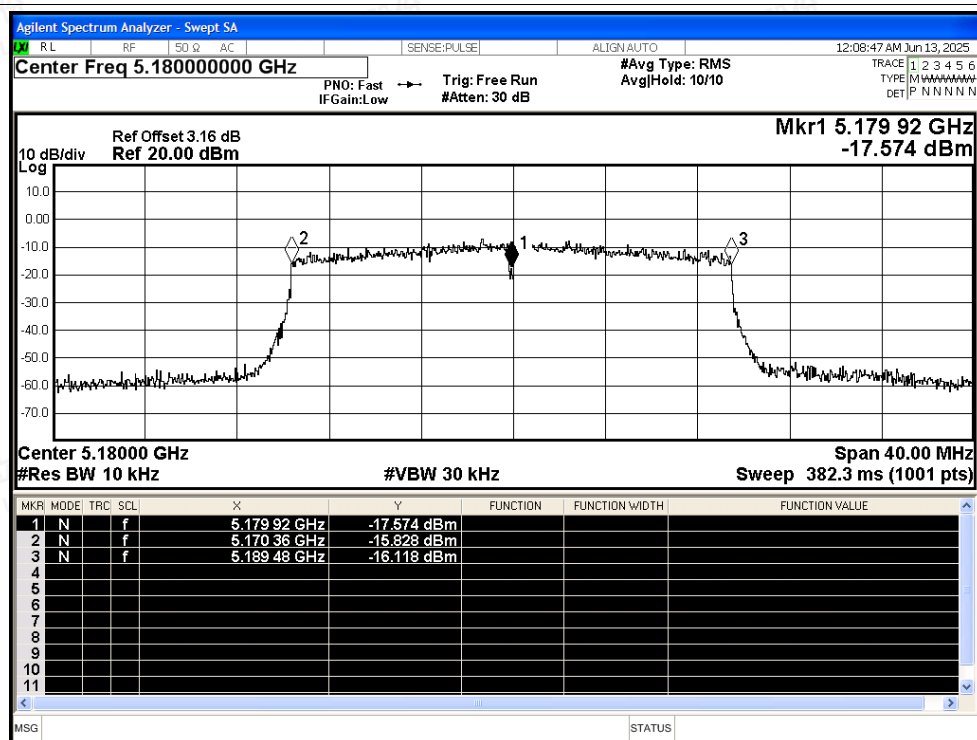

## Freq. Stability NVNT ax20 5200MHz Ant1

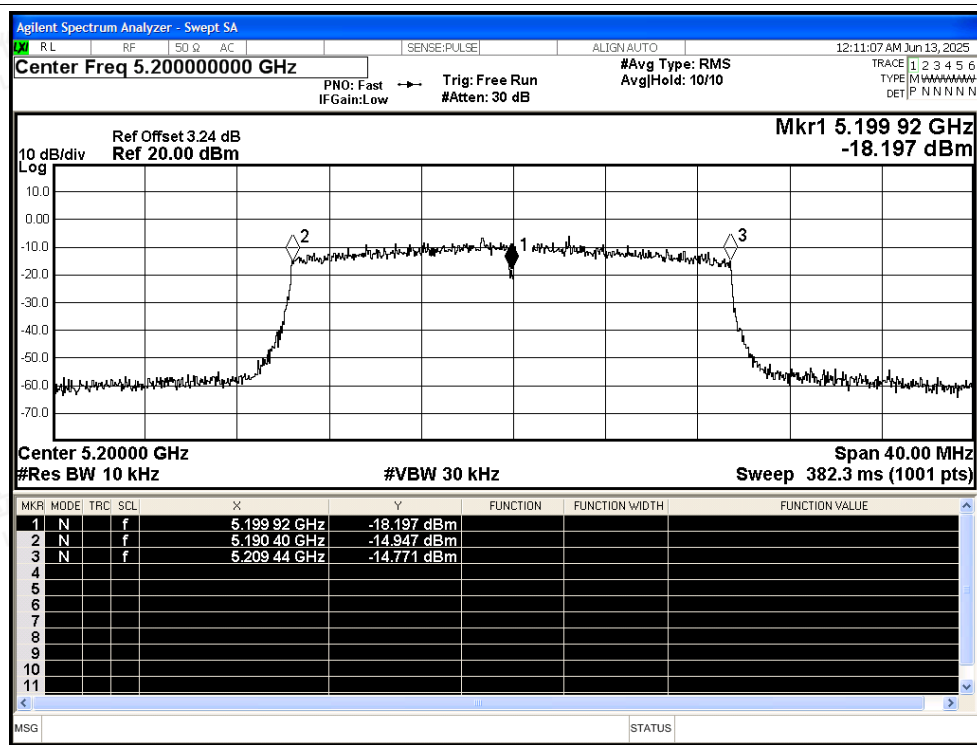

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5240MHz Ant1

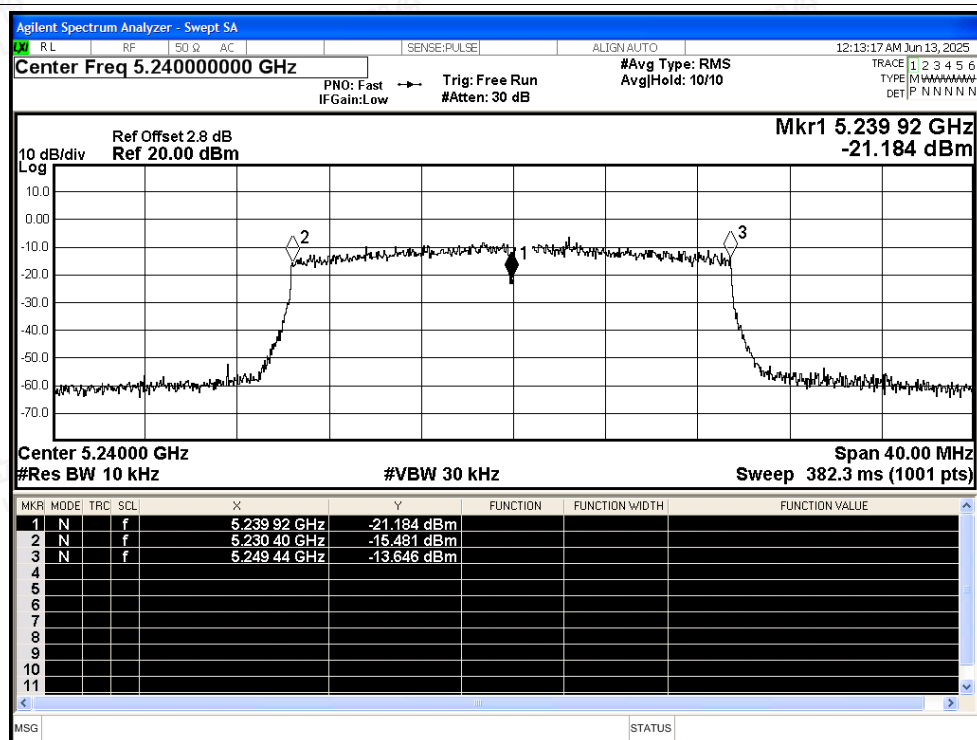

## Freq. Stability NVNT ax40 5190MHz Ant1

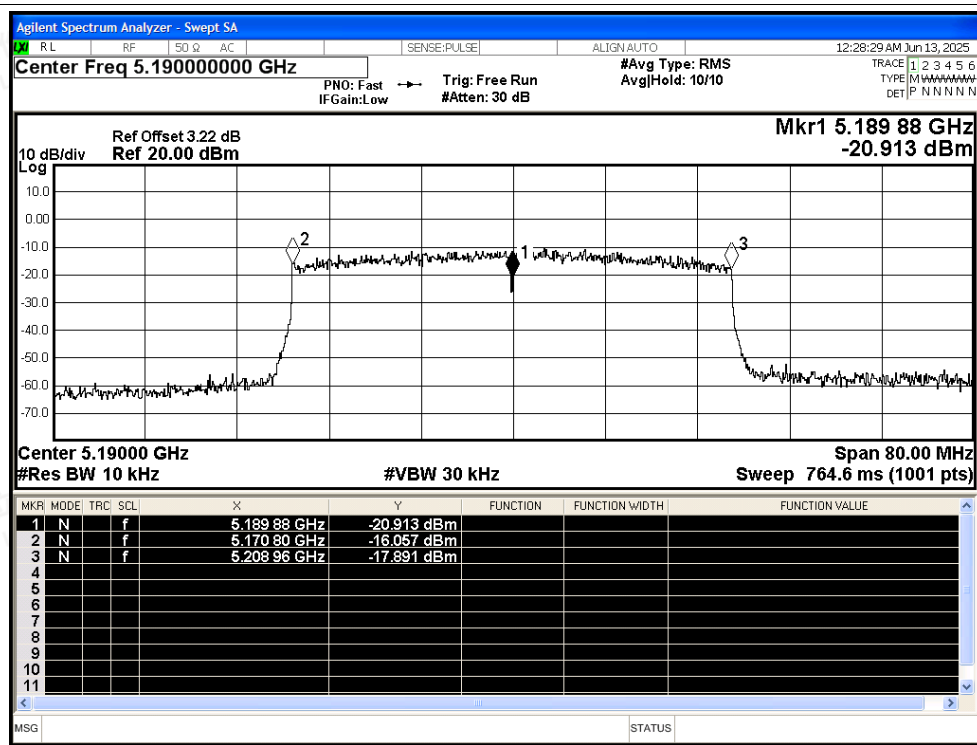

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax40 5230MHz Ant1

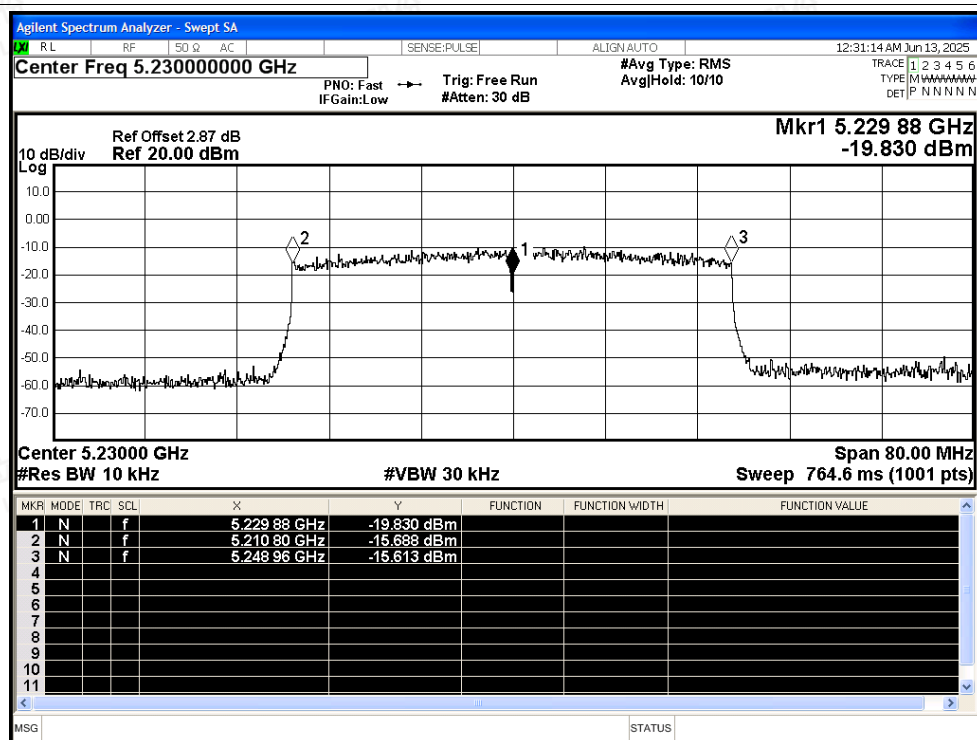

## Freq. Stability NVNT ax80 5210MHz Ant1

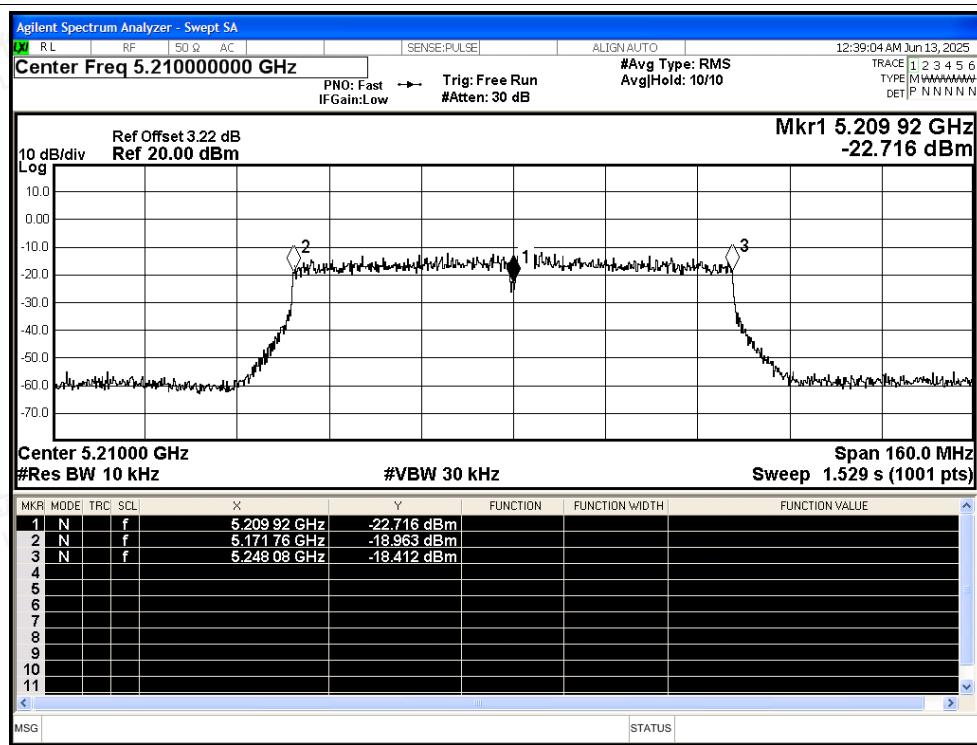

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5180            | Ant2    | 5179.92                  | -80000               | -15.44          | 25          | Pass    |
| NVNT      | a    | 5200            | Ant2    | 5199.9                   | -100000              | -19.23          | 25          | Pass    |
| NVNT      | a    | 5240            | Ant2    | 5239.92                  | -80000               | -15.27          | 25          | Pass    |
| NVNT      | n20  | 5180            | Ant2    | 5179.94                  | -60000               | -11.58          | 25          | Pass    |
| NVNT      | n20  | 5200            | Ant2    | 5199.92                  | -80000               | -15.38          | 25          | Pass    |
| NVNT      | n20  | 5240            | Ant2    | 5239.92                  | -80000               | -15.27          | 25          | Pass    |
| NVNT      | n40  | 5190            | Ant2    | 5189.96                  | -40000               | -7.71           | 25          | Pass    |
| NVNT      | n40  | 5230            | Ant2    | 5229.96                  | -40000               | -7.65           | 25          | Pass    |
| NVNT      | ac20 | 5180            | Ant2    | 5179.92                  | -80000               | -15.44          | 25          | Pass    |
| NVNT      | ac20 | 5200            | Ant2    | 5199.92                  | -80000               | -15.38          | 25          | Pass    |
| NVNT      | ac20 | 5240            | Ant2    | 5239.92                  | -80000               | -15.27          | 25          | Pass    |
| NVNT      | ac40 | 5190            | Ant2    | 5189.92                  | -80000               | -15.41          | 25          | Pass    |
| NVNT      | ac40 | 5230            | Ant2    | 5229.96                  | -40000               | -7.65           | 25          | Pass    |
| NVNT      | ac80 | 5210            | Ant2    | 5210                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5180            | Ant2    | 5179.92                  | -80000               | -15.44          | 25          | Pass    |
| NVNT      | ax20 | 5200            | Ant2    | 5199.92                  | -80000               | -15.38          | 25          | Pass    |
| NVNT      | ax20 | 5240            | Ant2    | 5239.92                  | -80000               | -15.27          | 25          | Pass    |
| NVNT      | ax40 | 5190            | Ant2    | 5189.88                  | -120000              | -23.12          | 25          | Pass    |
| NVNT      | ax40 | 5230            | Ant2    | 5229.88                  | -120000              | -22.94          | 25          | Pass    |
| NVNT      | ax80 | 5210            | Ant2    | 5209.92                  | -80000               | -15.36          | 25          | Pass    |






## Test Graphs

## Freq. Stability NVNT a 5180MHz Ant2

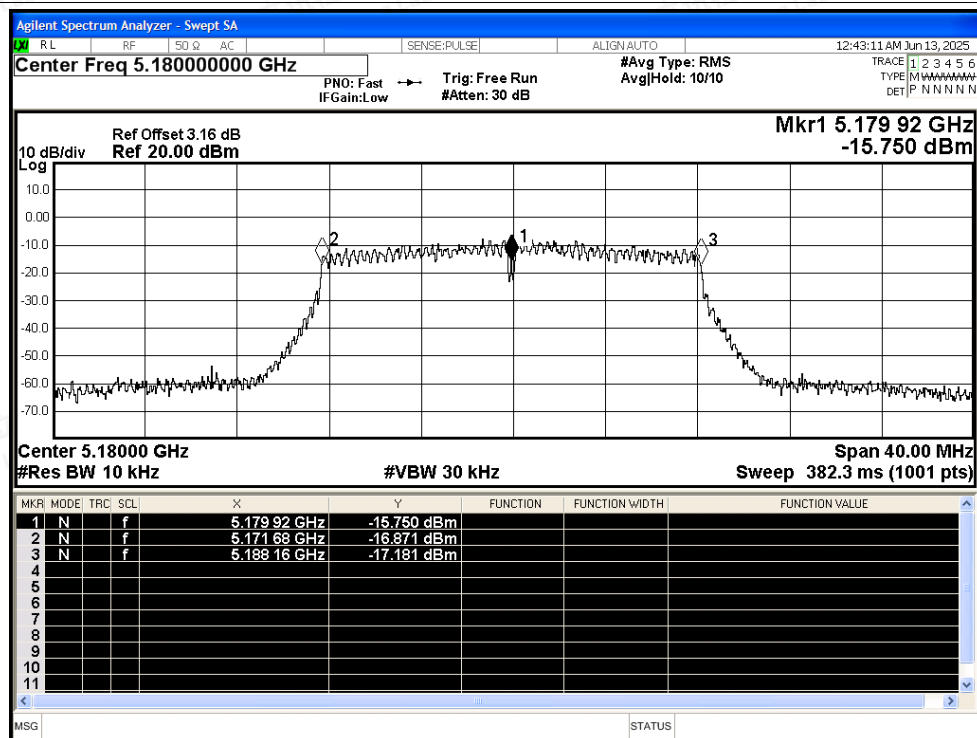

## Freq. Stability NVNT a 5200MHz Ant2

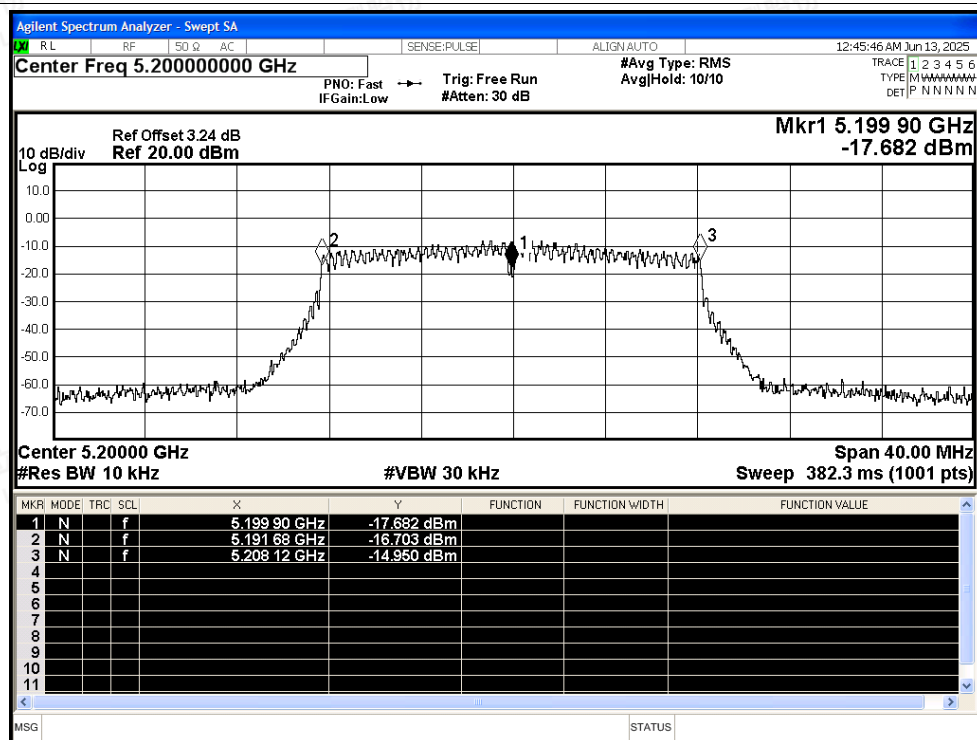

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT a 5240MHz Ant2

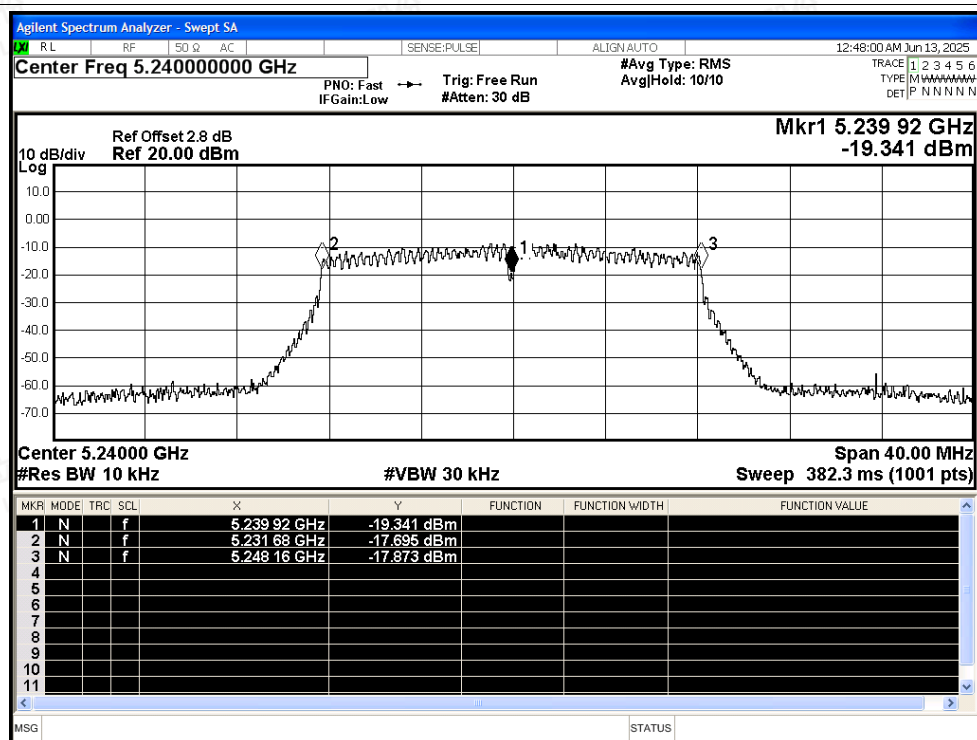

## Freq. Stability NVNT n20 5180MHz Ant2

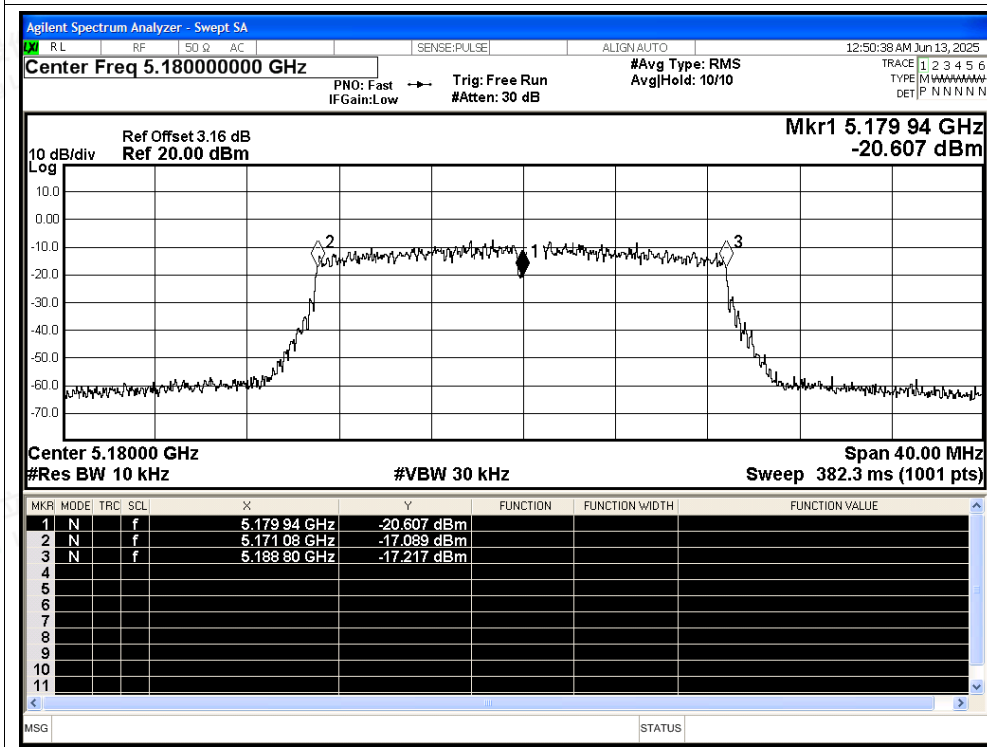

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n20 5200MHz Ant2

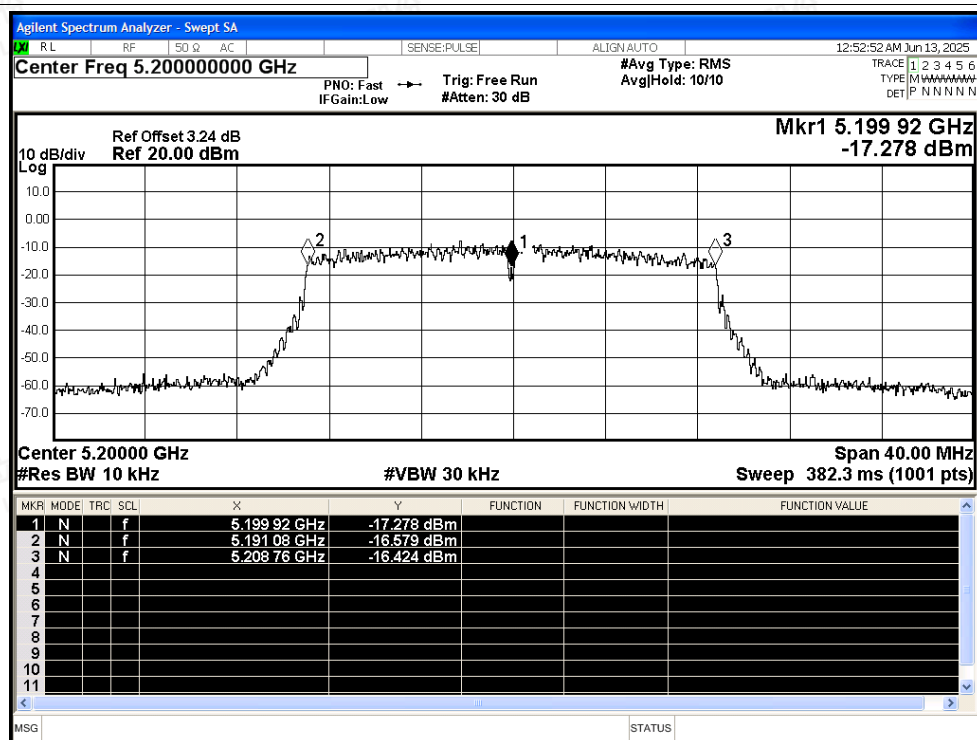

## Freq. Stability NVNT n20 5240MHz Ant2

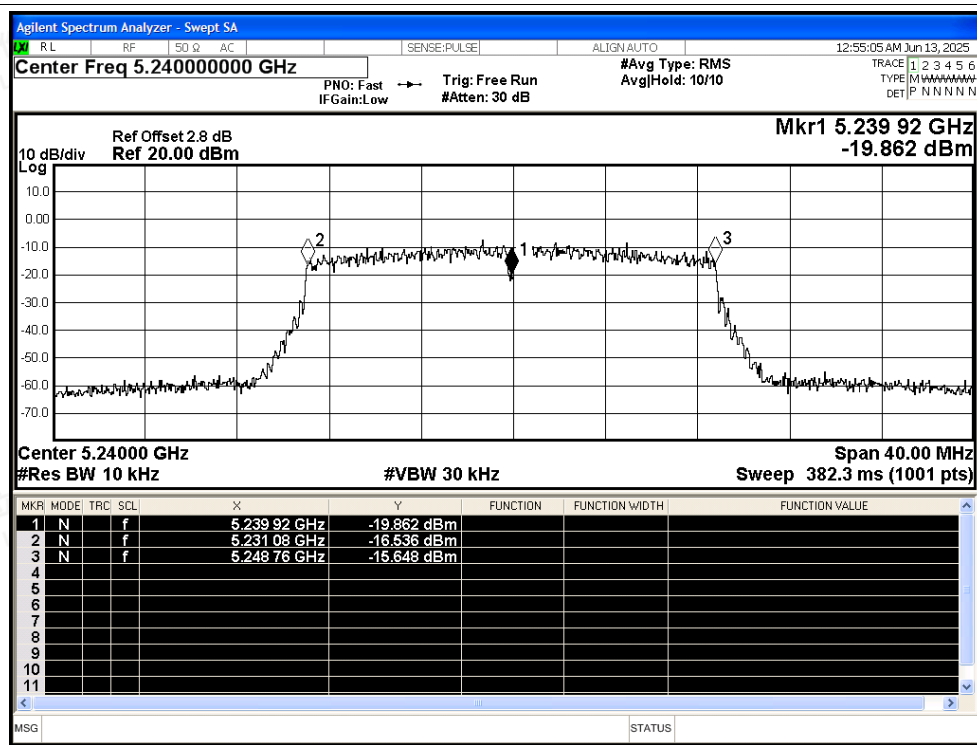

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5190MHz Ant2

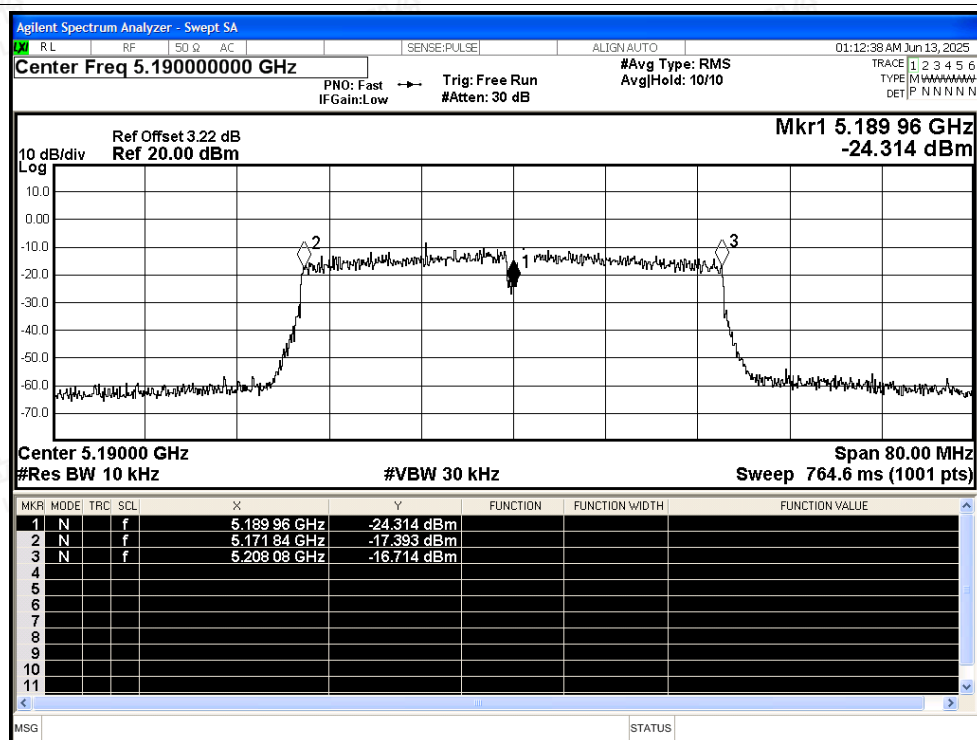

## Freq. Stability NVNT n40 5230MHz Ant2

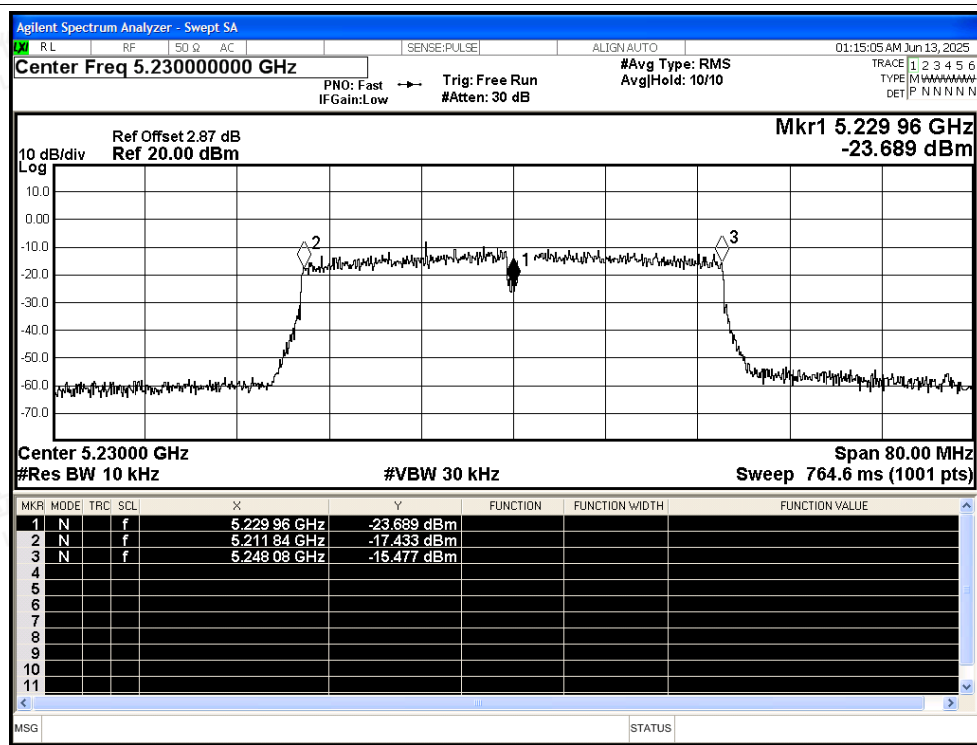

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5180MHz Ant2

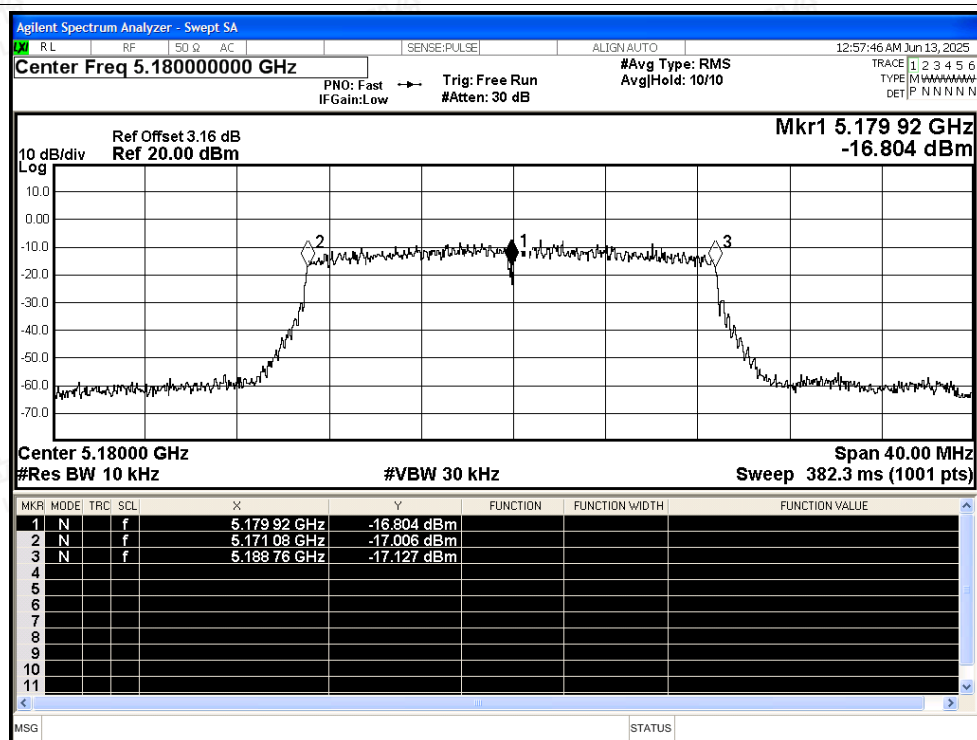

## Freq. Stability NVNT ac20 5200MHz Ant2

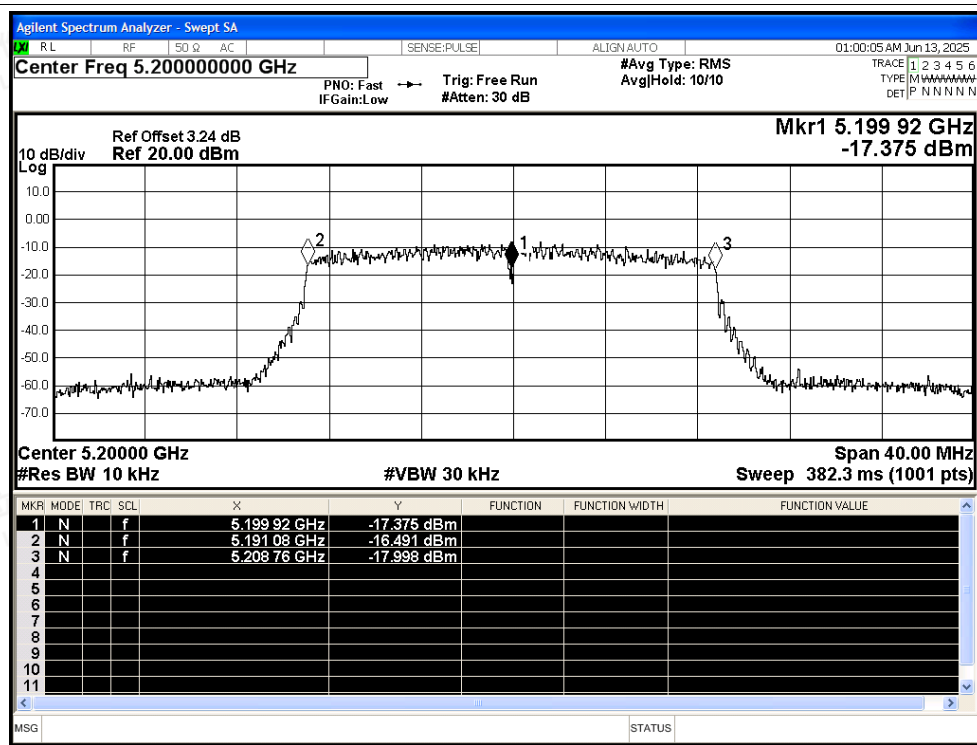

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5240MHz Ant2

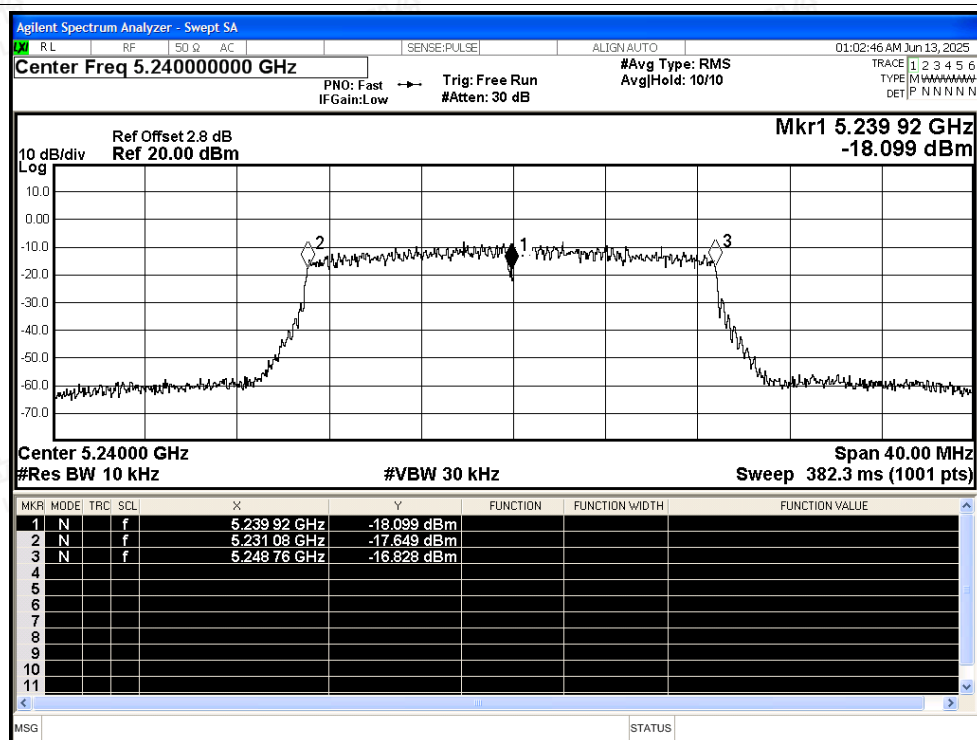

## Freq. Stability NVNT ac40 5190MHz Ant2

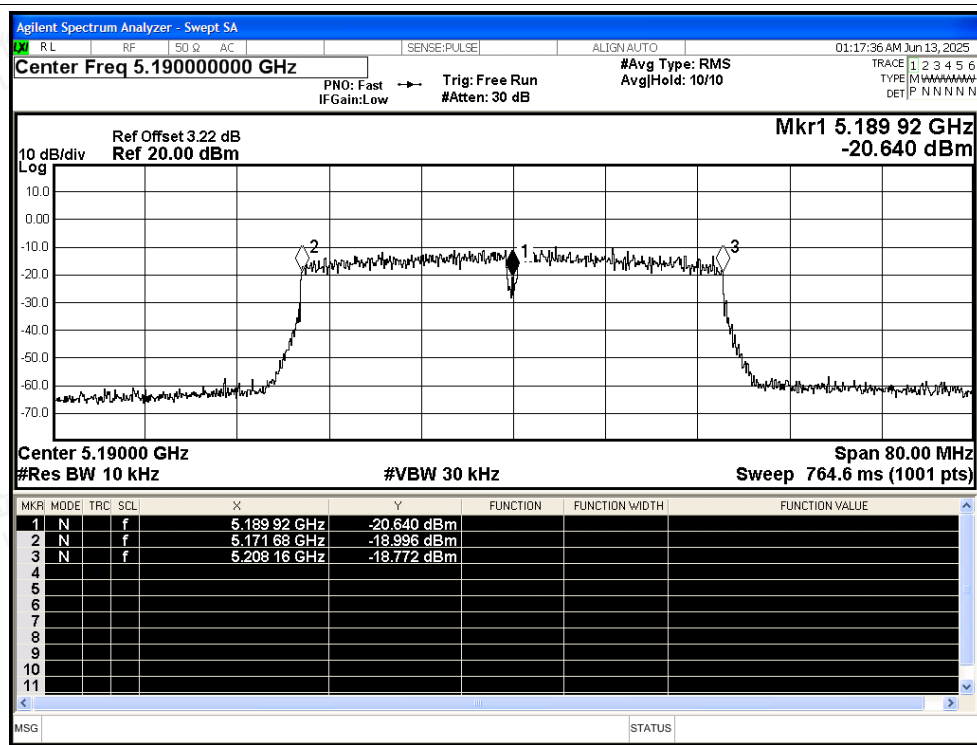

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac40 5230MHz Ant2

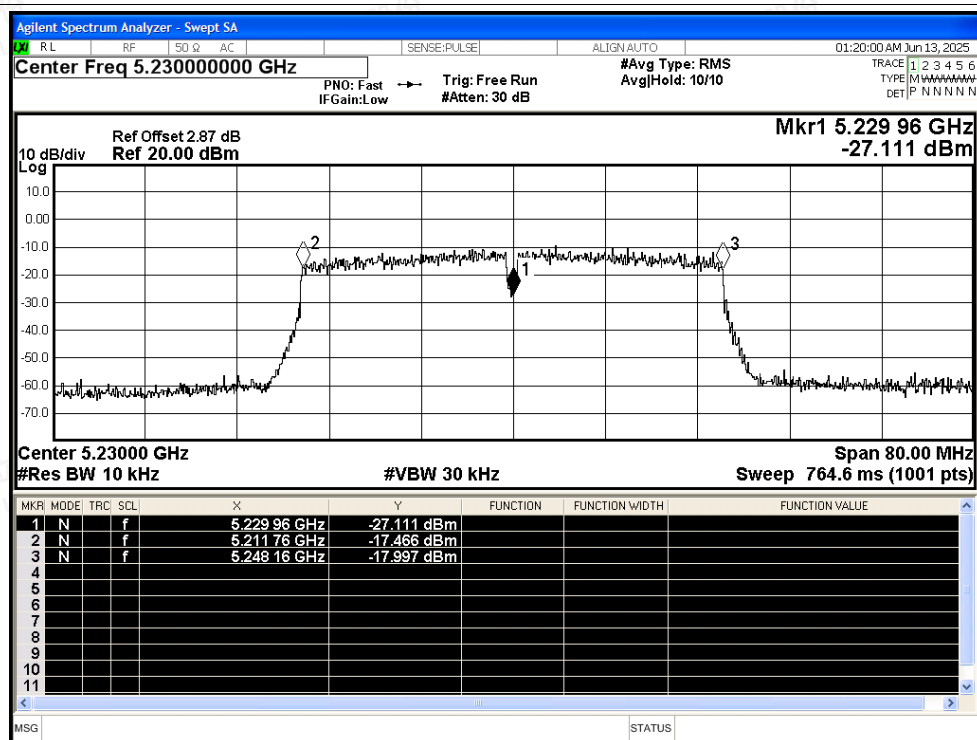

## Freq. Stability NVNT ac80 5210MHz Ant2

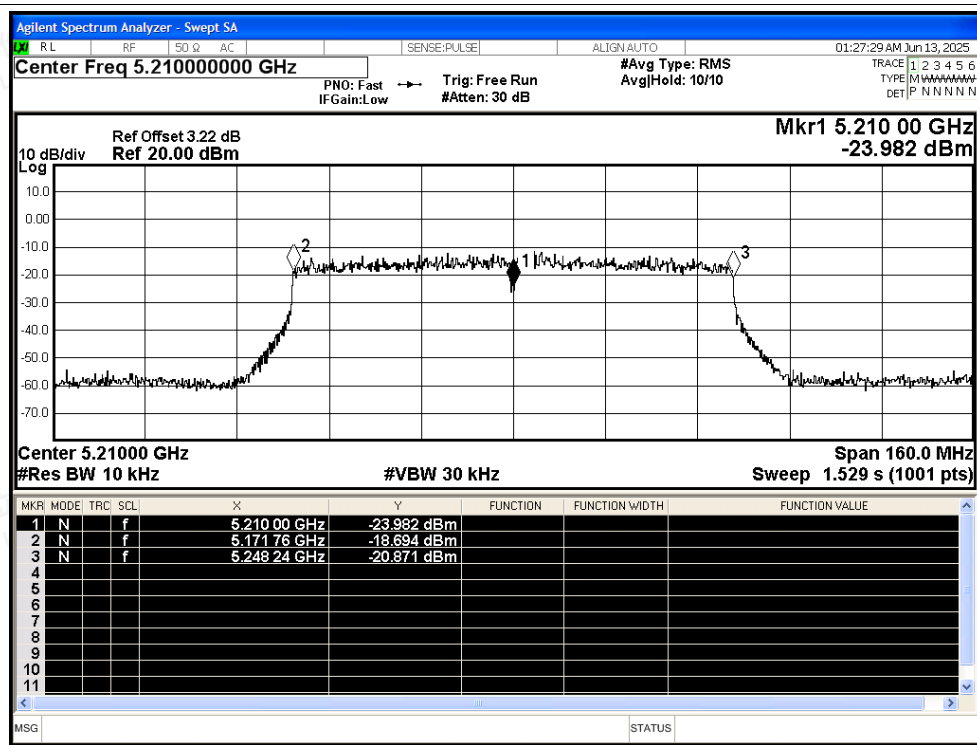

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5180MHz Ant2

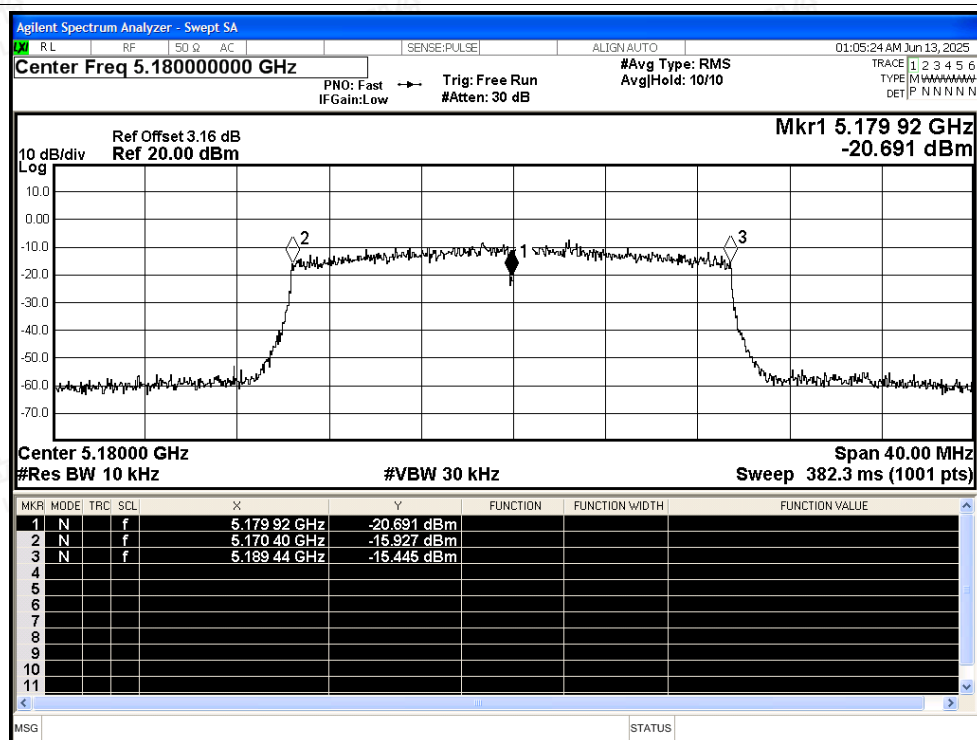

## Freq. Stability NVNT ax20 5200MHz Ant2

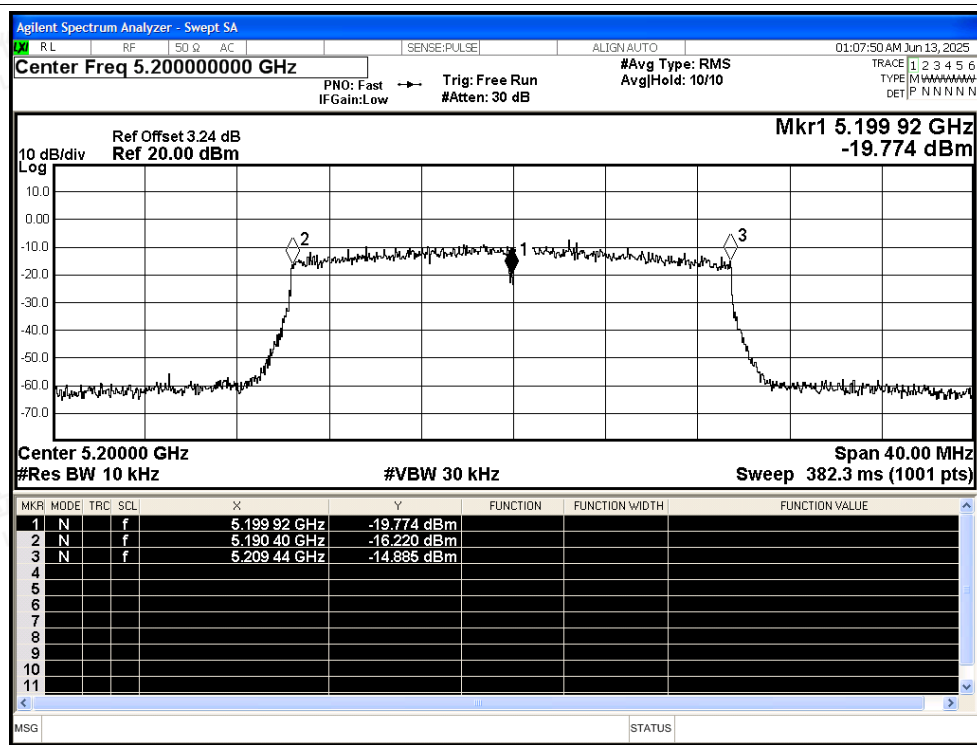

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5240MHz Ant2

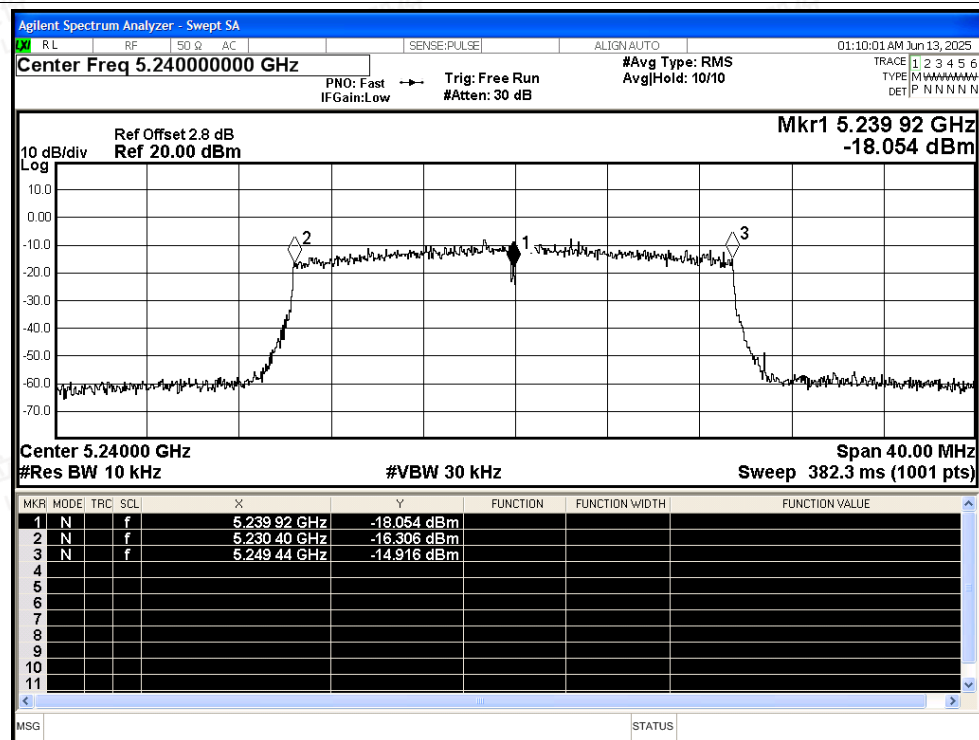

## Freq. Stability NVNT ax40 5190MHz Ant2

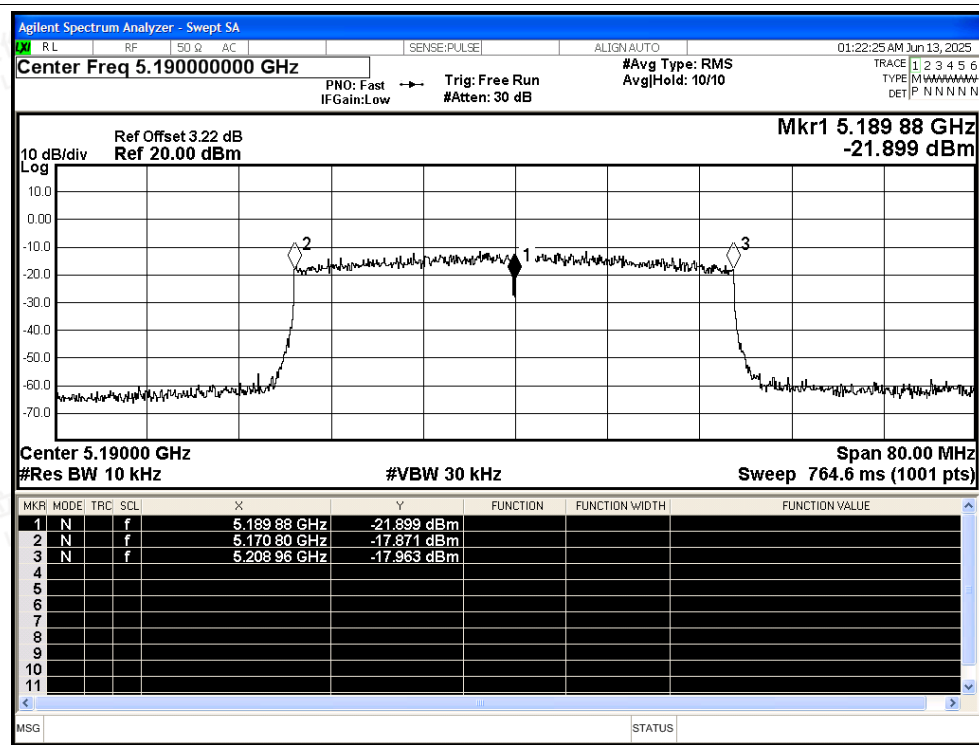

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax40 5230MHz Ant2

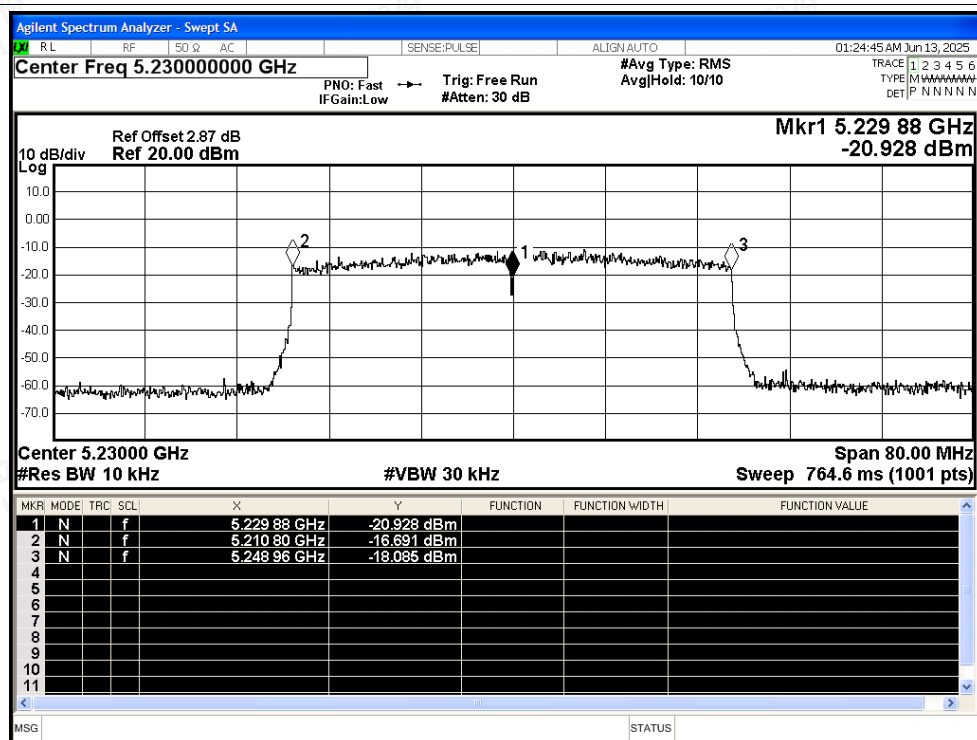

## Freq. Stability NVNT ax80 5210MHz Ant2

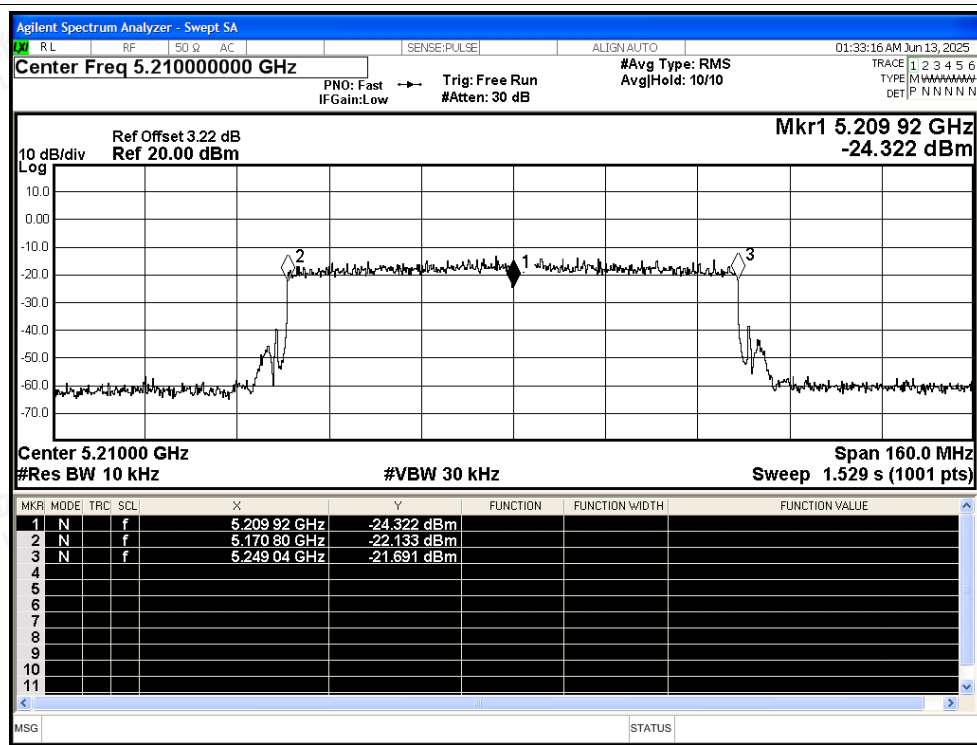

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## D.6 Duty Cycle


| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5180            | Ant1    | 93.02          | 0.31                   | 0.74      |
| NVNT      | a    | 5200            | Ant1    | 93.02          | 0.31                   | 0.74      |
| NVNT      | a    | 5240            | Ant1    | 93.02          | 0.31                   | 0.74      |
| NVNT      | n20  | 5180            | Ant1    | 91.85          | 0.37                   | 0.87      |
| NVNT      | n20  | 5200            | Ant1    | 91.92          | 0.37                   | 0.87      |
| NVNT      | n20  | 5240            | Ant1    | 91.92          | 0.37                   | 0.87      |
| NVNT      | n40  | 5190            | Ant1    | 85.01          | 0.71                   | 1.75      |
| NVNT      | n40  | 5230            | Ant1    | 84.89          | 0.71                   | 1.75      |
| NVNT      | ac20 | 5180            | Ant1    | 91.95          | 0.36                   | 0.87      |
| NVNT      | ac20 | 5200            | Ant1    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ac20 | 5240            | Ant1    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ac40 | 5190            | Ant1    | 84.98          | 0.71                   | 1.73      |
| NVNT      | ac40 | 5230            | Ant1    | 84.98          | 0.71                   | 1.73      |
| NVNT      | ac80 | 5210            | Ant1    | 73.91          | 1.31                   | 3.46      |
| NVNT      | ax20 | 5180            | Ant1    | 90.73          | 0.42                   | 1.01      |
| NVNT      | ax20 | 5200            | Ant1    | 90.63          | 0.43                   | 1.01      |
| NVNT      | ax20 | 5240            | Ant1    | 90.63          | 0.43                   | 1.01      |
| NVNT      | ax40 | 5190            | Ant1    | 83.63          | 0.78                   | 1.92      |
| NVNT      | ax40 | 5230            | Ant1    | 83.63          | 0.78                   | 1.92      |
| NVNT      | ax80 | 5210            | Ant1    | 73.91          | 1.31                   | 3.46      |






## Test Graphs

## Duty Cycle NVNT a 5180MHz Ant1

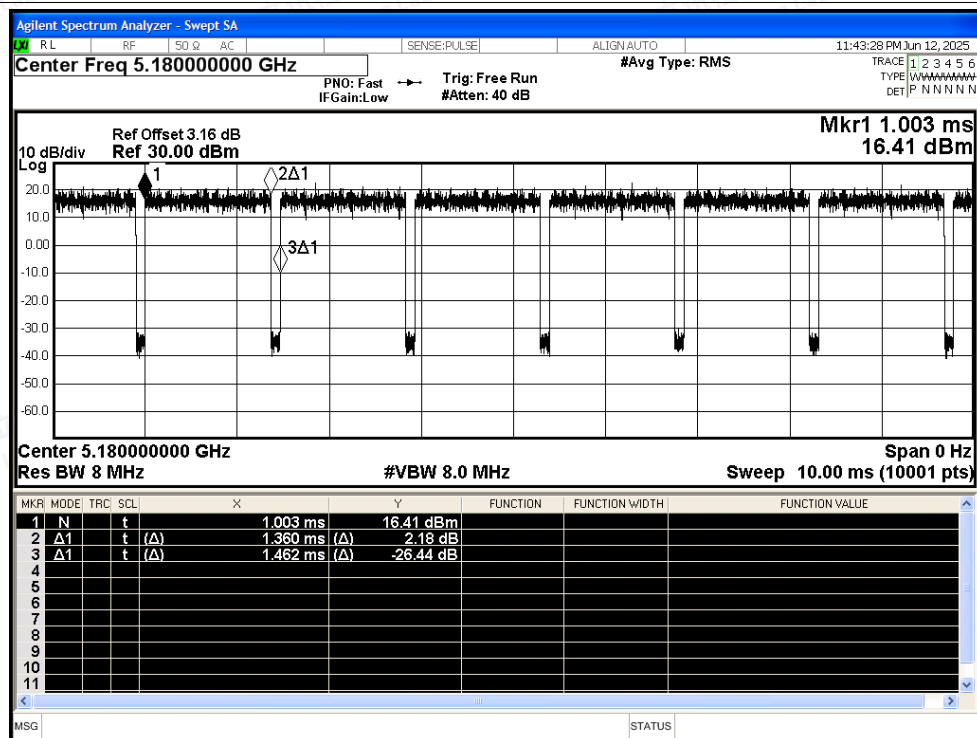

## Duty Cycle NVNT a 5200MHz Ant1

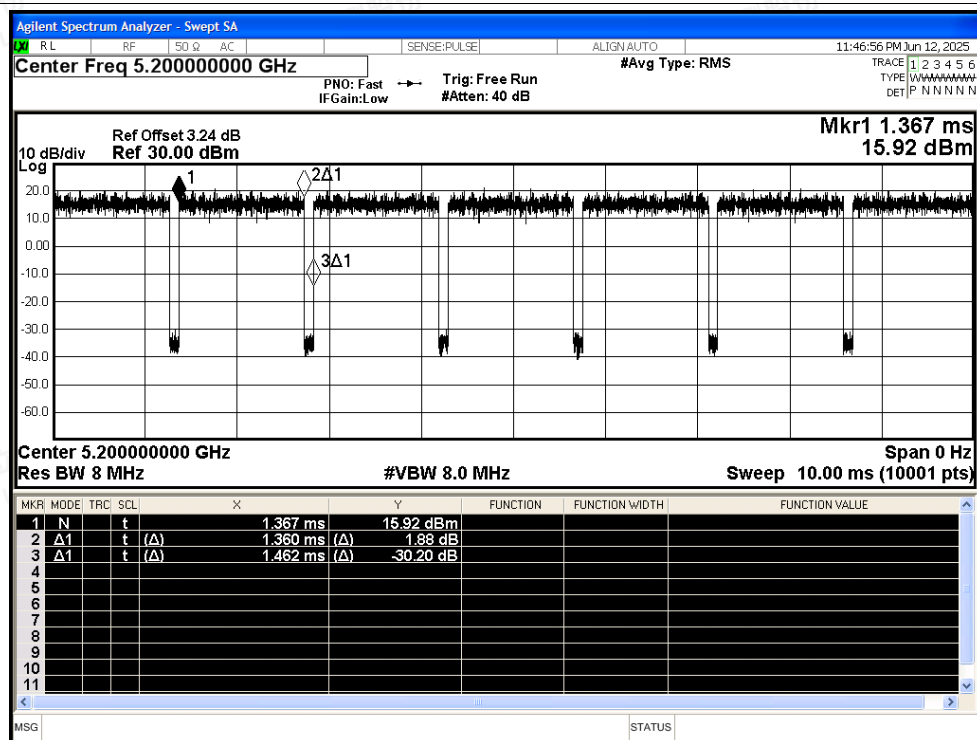

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5240MHz Ant1

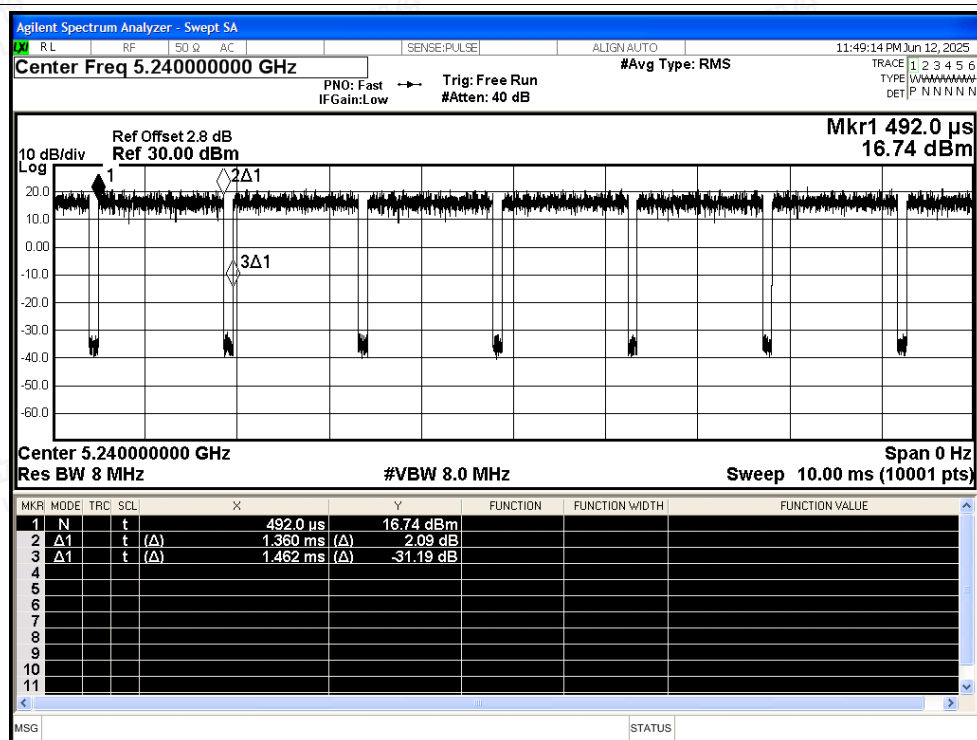

## Duty Cycle NVNT n20 5180MHz Ant1

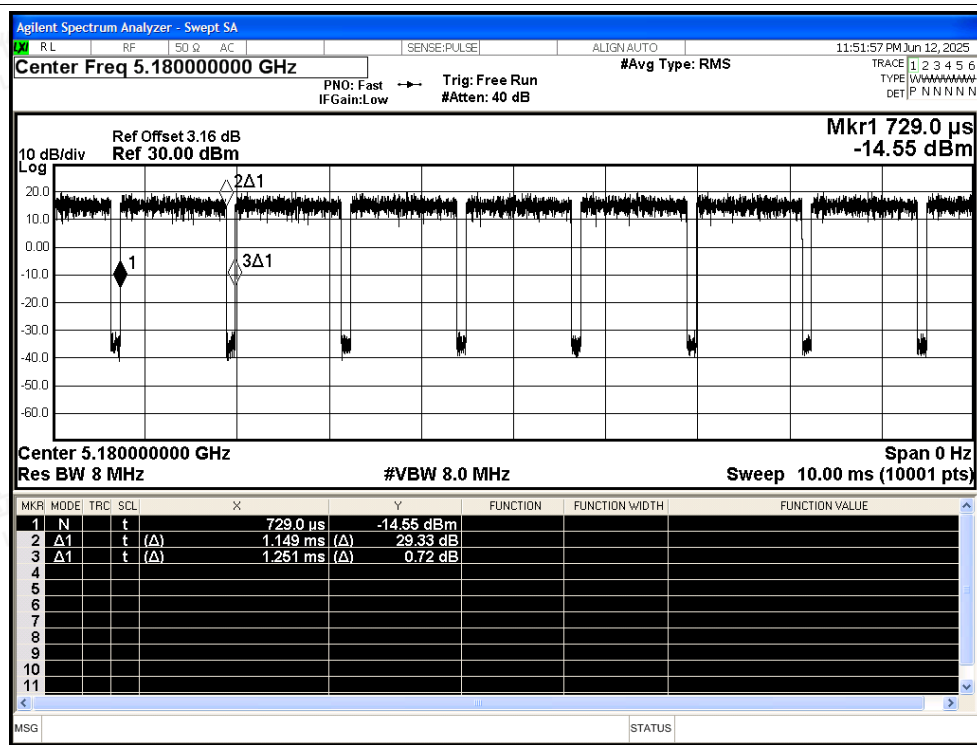

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n20 5200MHz Ant1

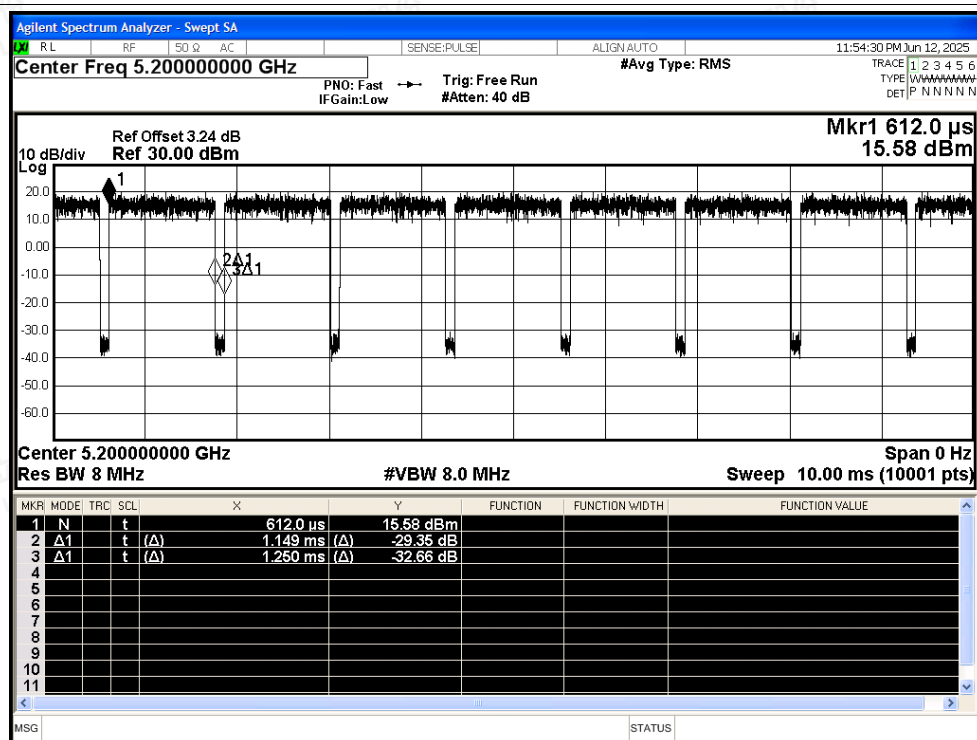

## Duty Cycle NVNT n20 5240MHz Ant1

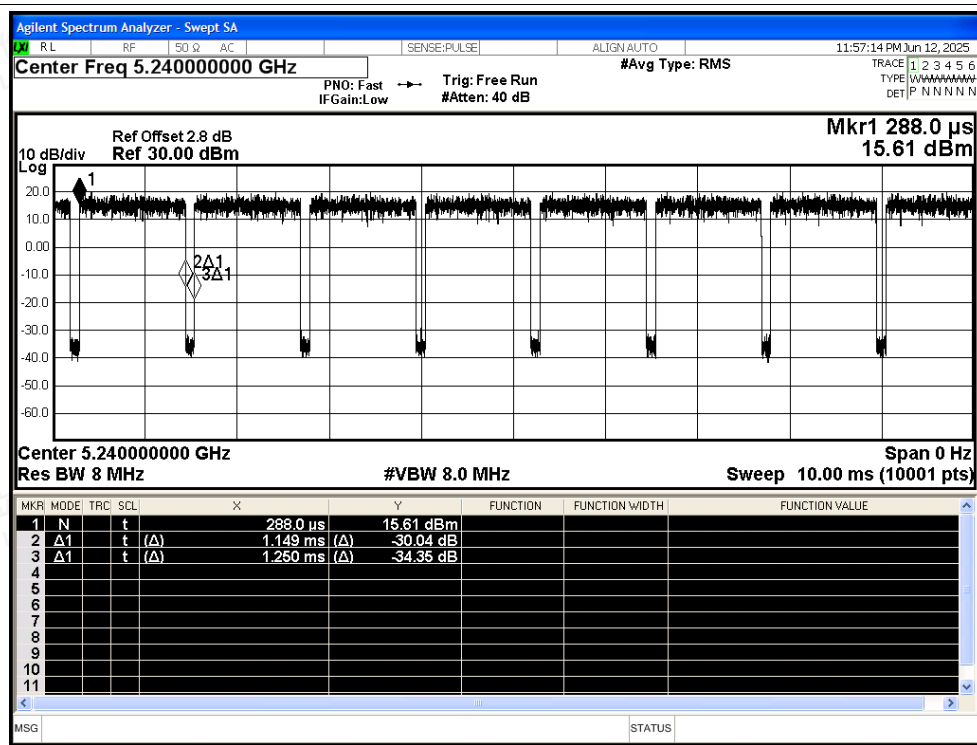

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5190MHz Ant1

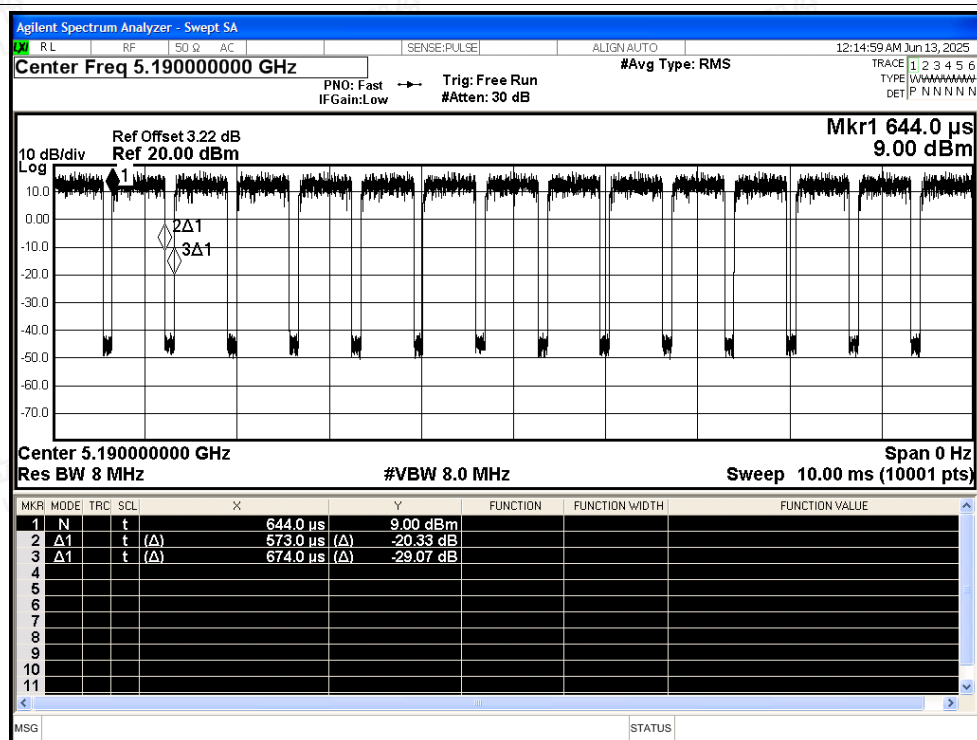

## Duty Cycle NVNT n40 5230MHz Ant1

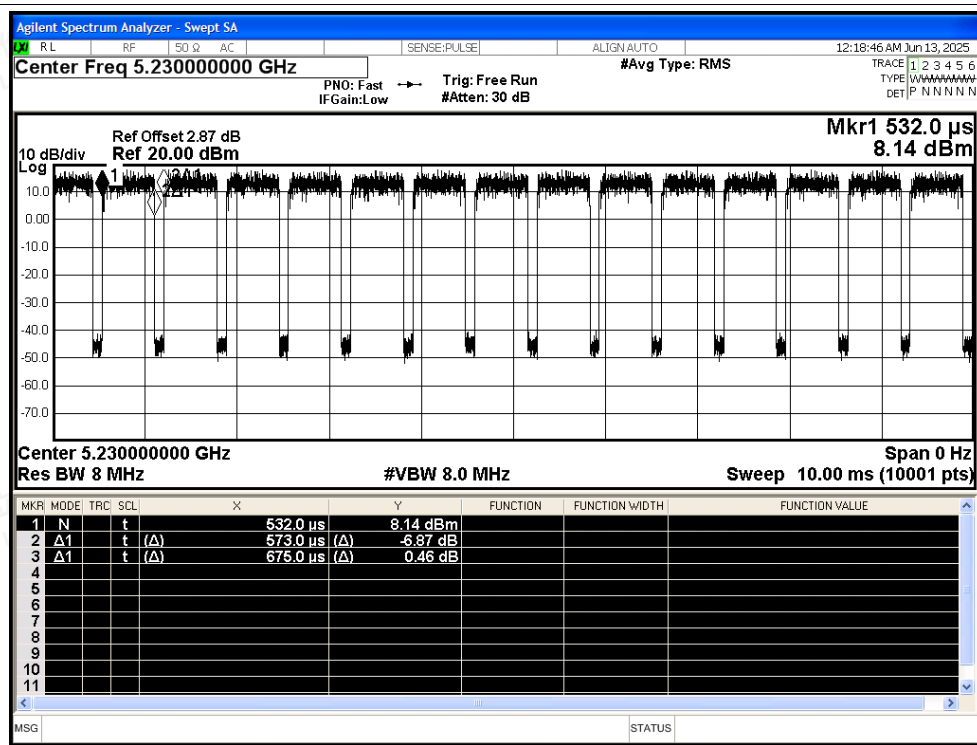

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5180MHz Ant1

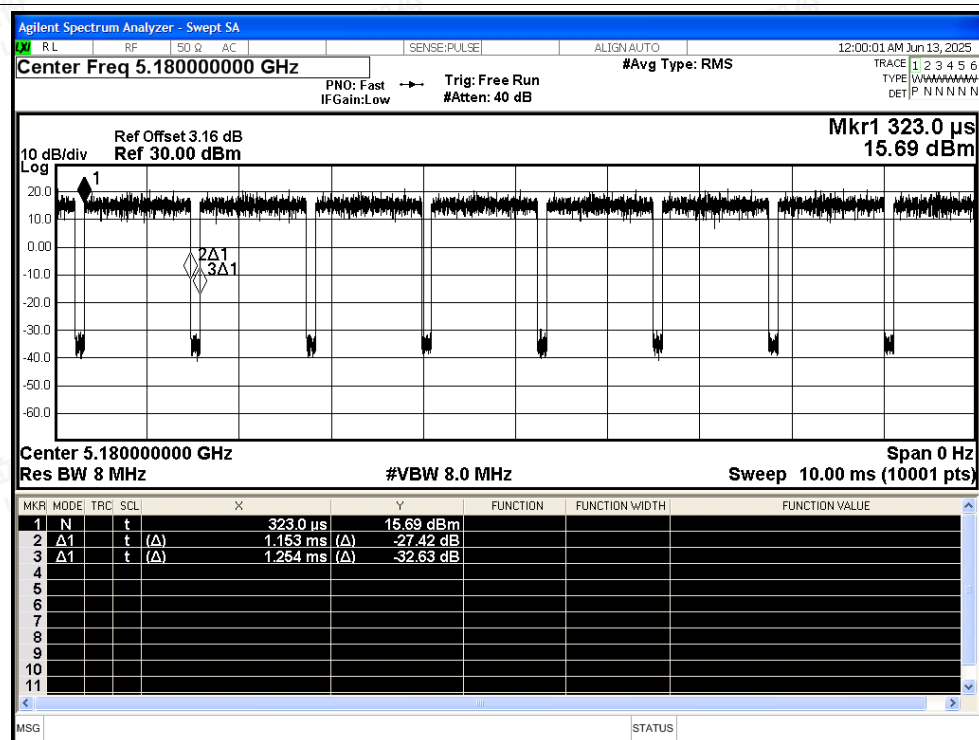

## Duty Cycle NVNT ac20 5200MHz Ant1

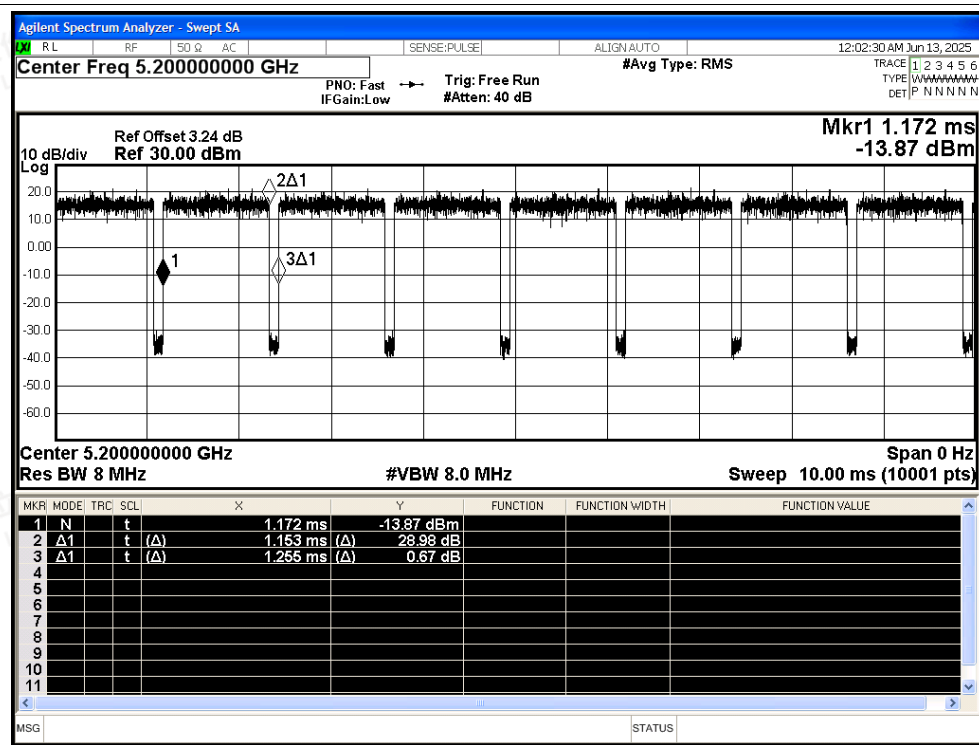

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5240MHz Ant1

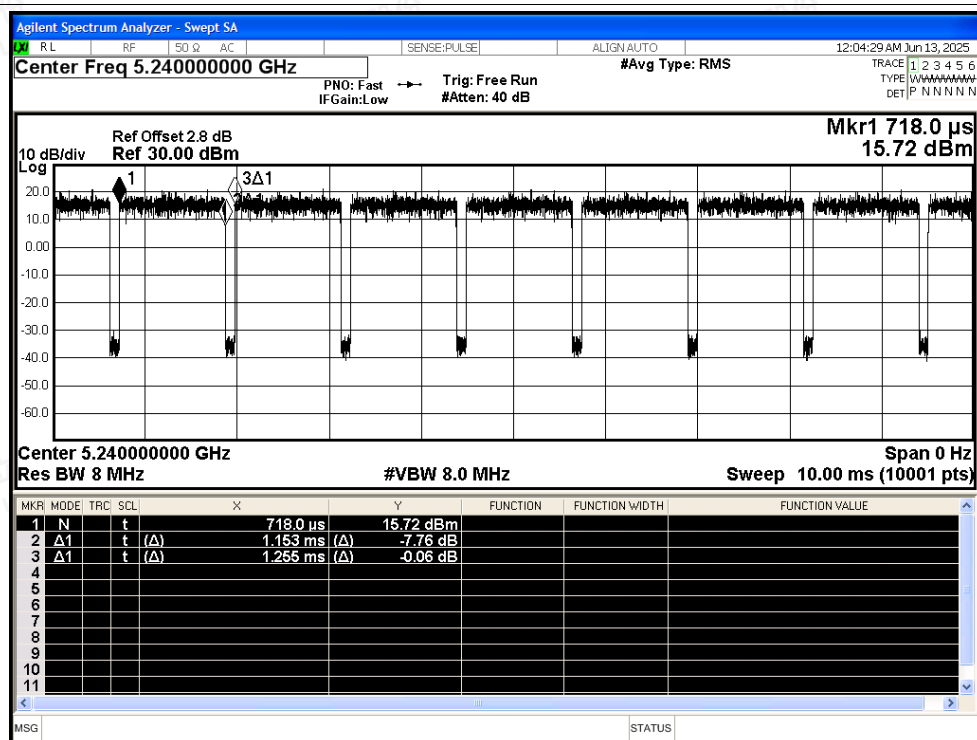

## Duty Cycle NVNT ac40 5190MHz Ant1

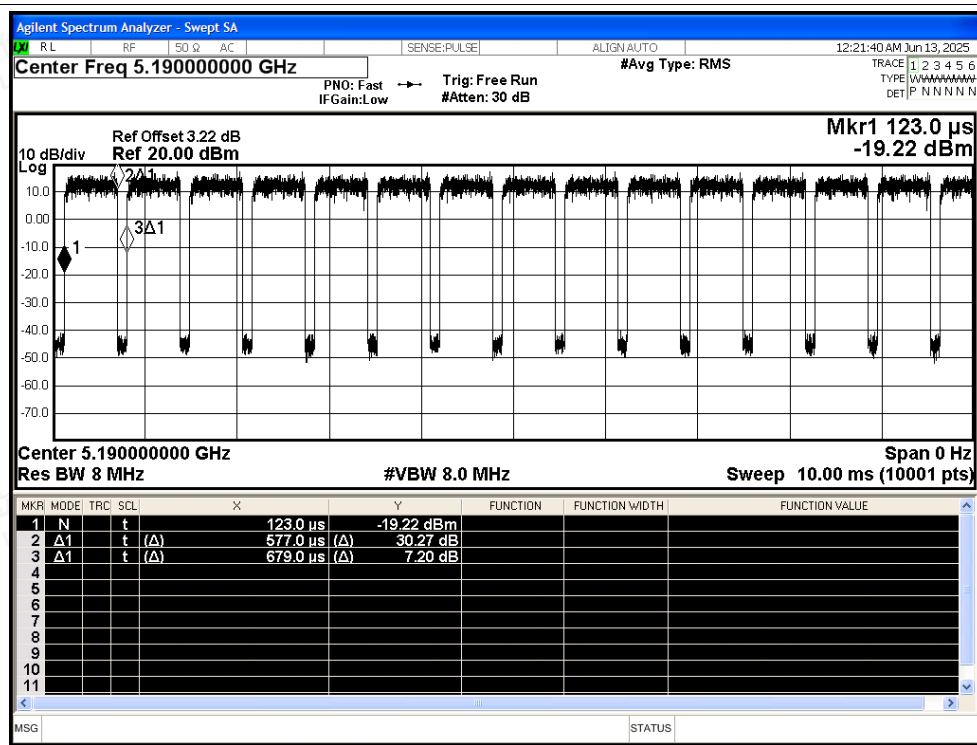

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5230MHz Ant1

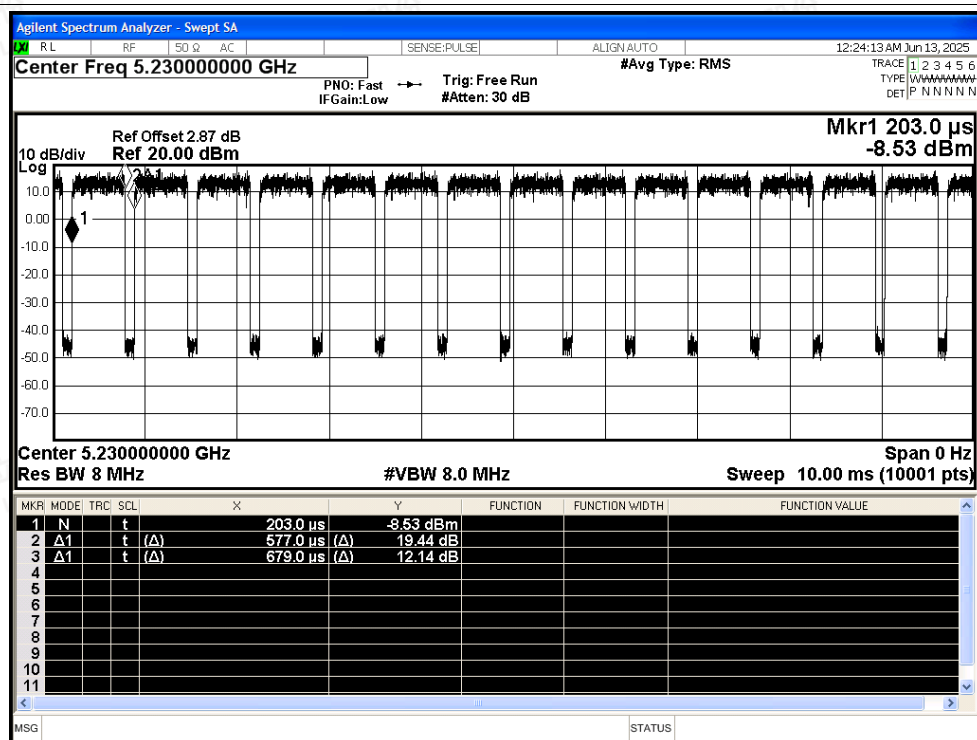

## Duty Cycle NVNT ac80 5210MHz Ant1

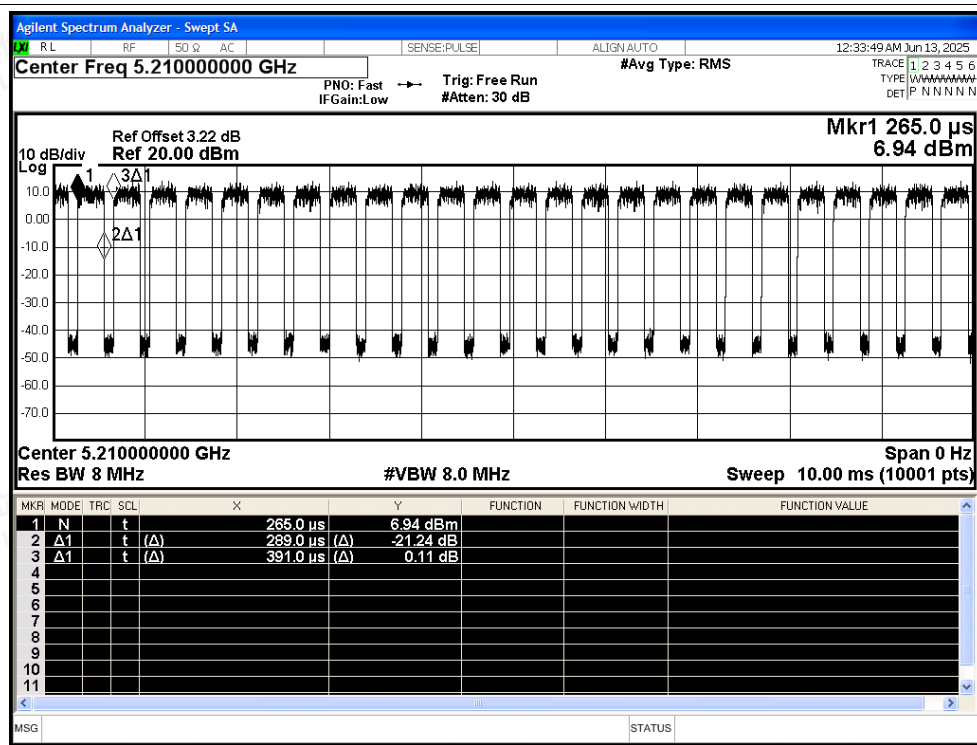

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5180MHz Ant1

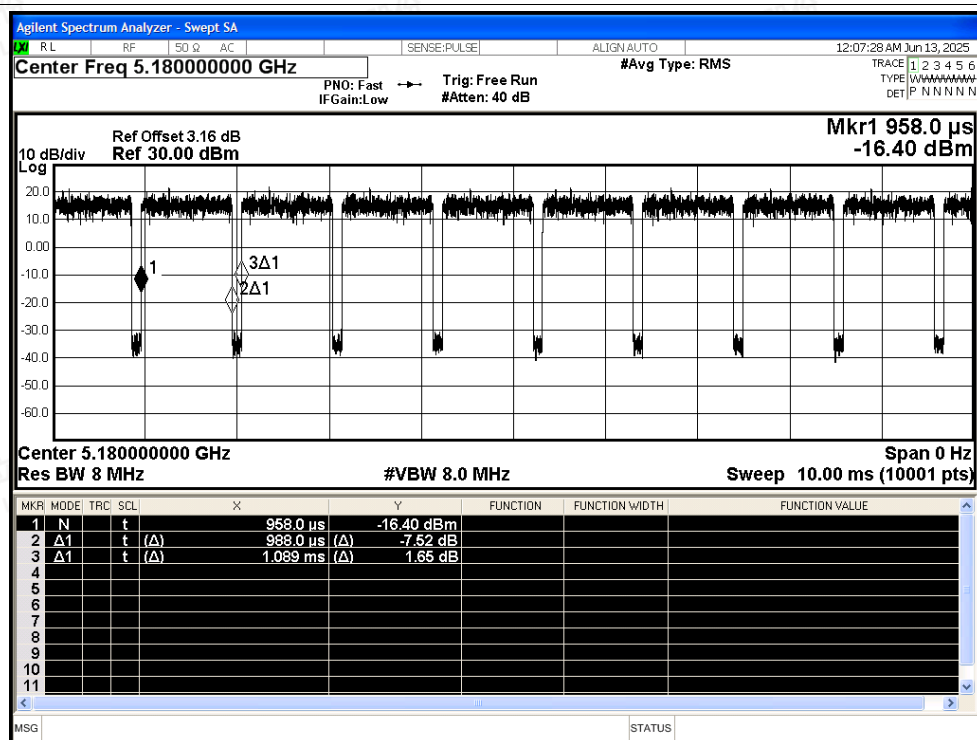

## Duty Cycle NVNT ax20 5200MHz Ant1

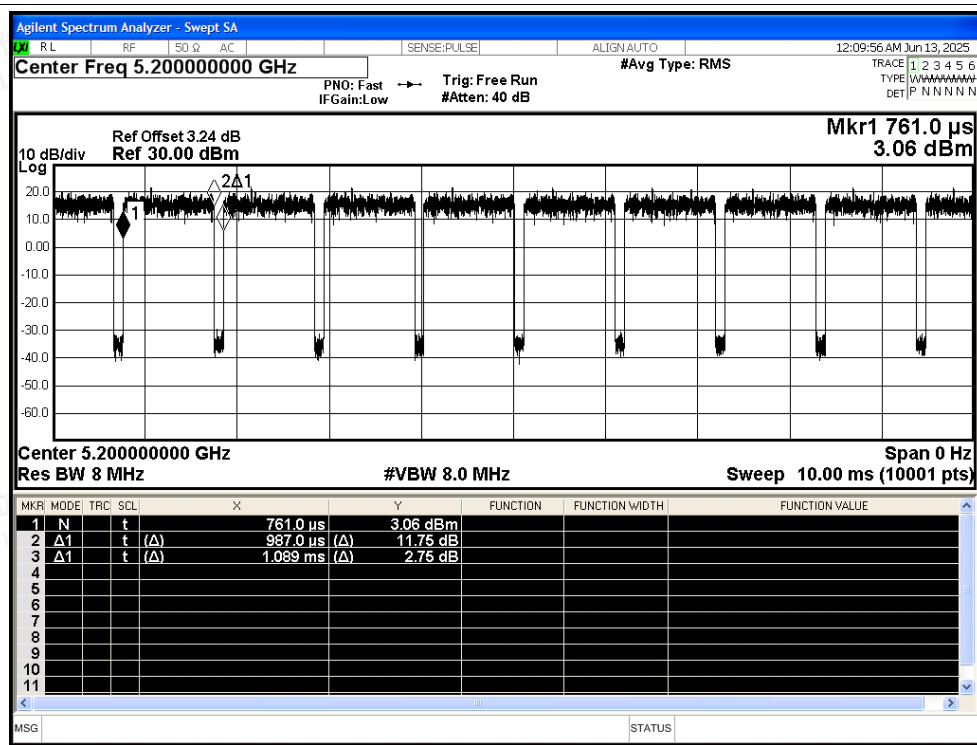

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5240MHz Ant1

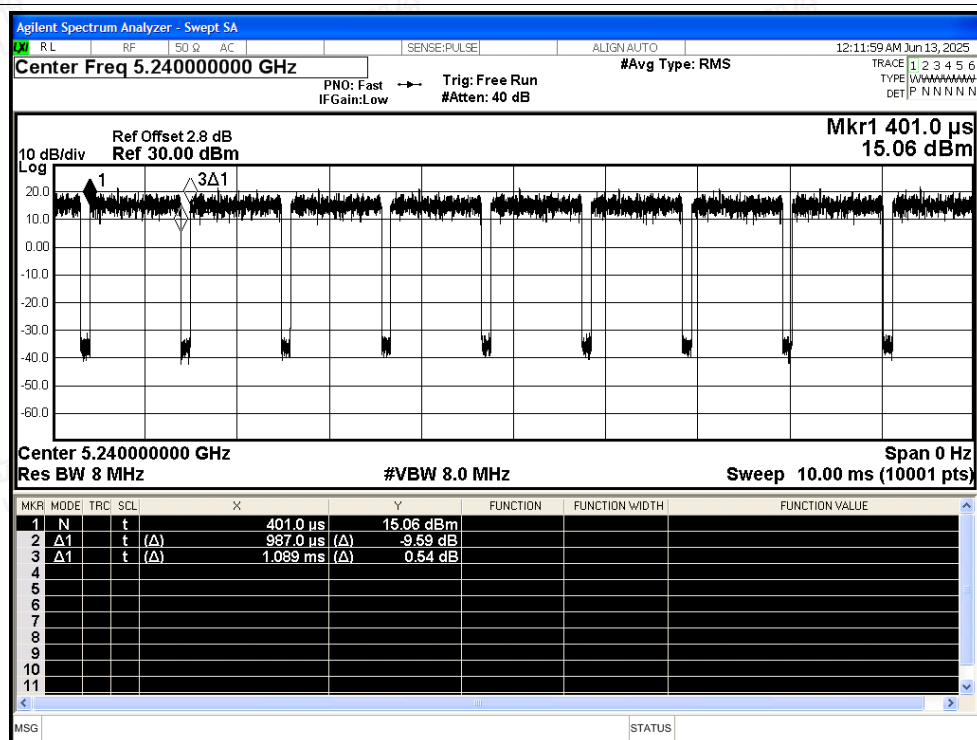

## Duty Cycle NVNT ax40 5190MHz Ant1

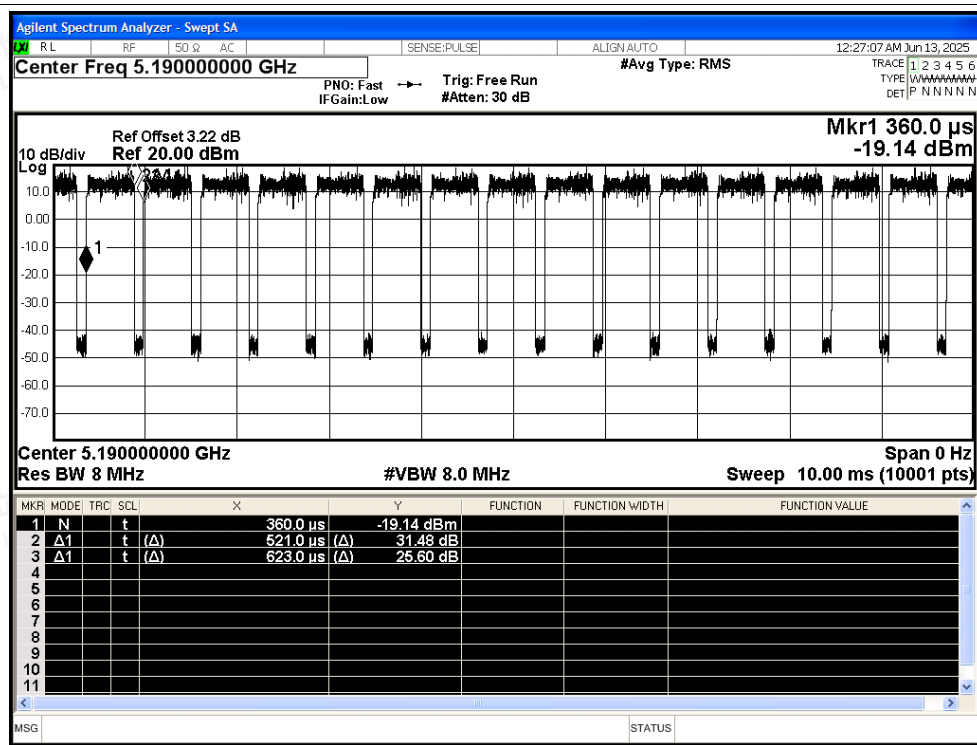

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5230MHz Ant1

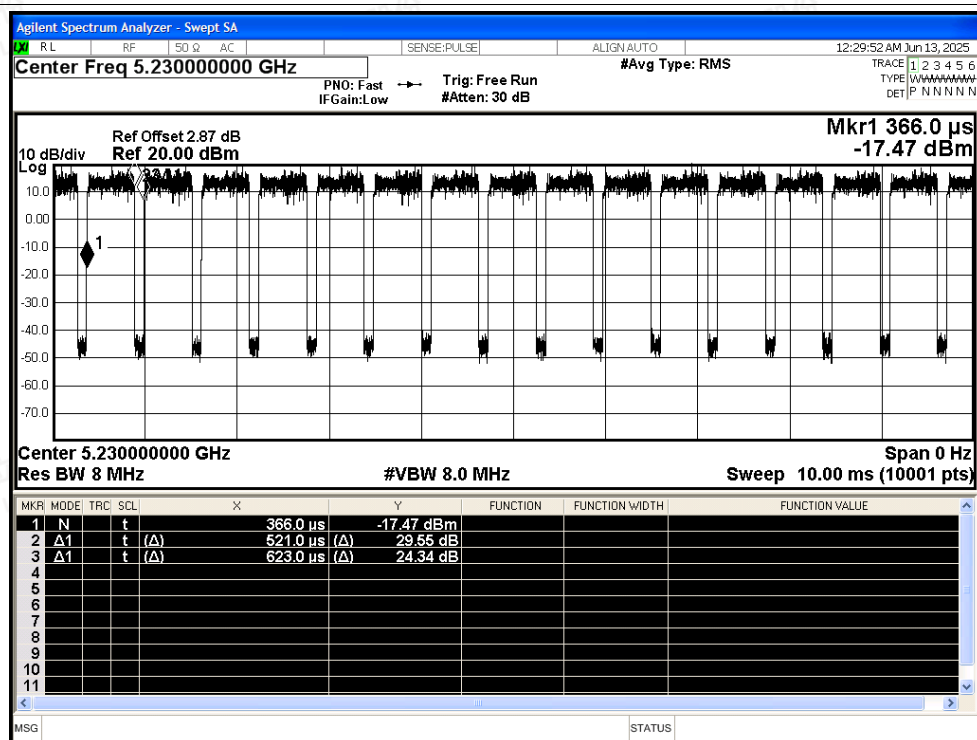

## Duty Cycle NVNT ax80 5210MHz Ant1

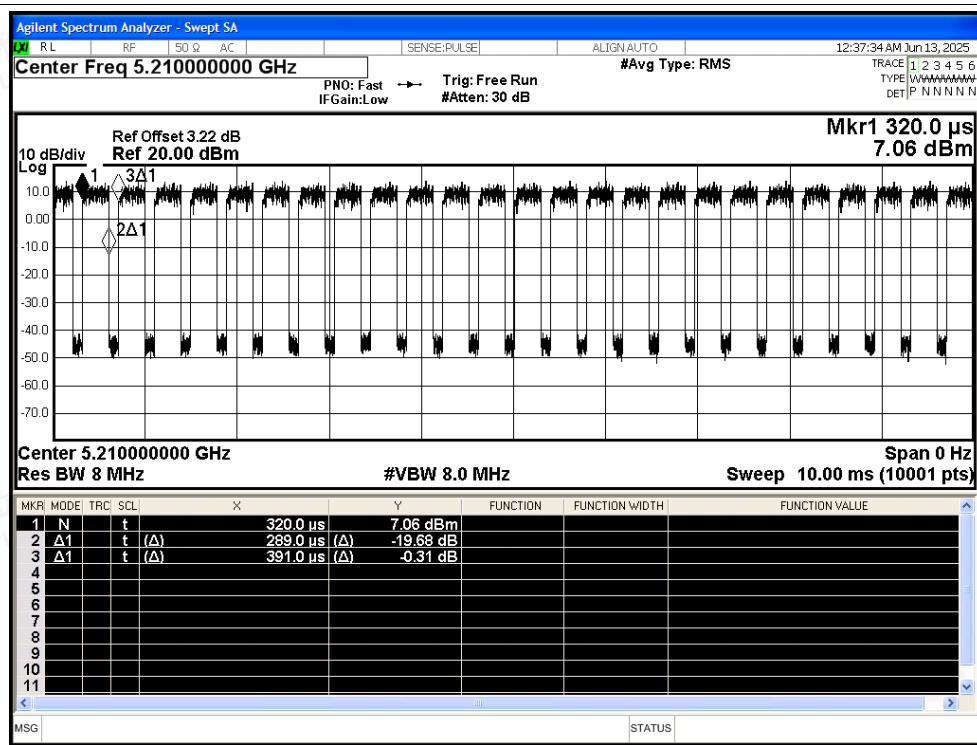

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5180            | Ant2    | 93.03          | 0.31                   | 0.73      |
| NVNT      | a    | 5200            | Ant2    | 93.02          | 0.31                   | 0.74      |
| NVNT      | a    | 5240            | Ant2    | 93.02          | 0.31                   | 0.74      |
| NVNT      | n20  | 5180            | Ant2    | 91.93          | 0.37                   | 0.87      |
| NVNT      | n20  | 5200            | Ant2    | 91.85          | 0.37                   | 0.87      |
| NVNT      | n20  | 5240            | Ant2    | 91.93          | 0.37                   | 0.87      |
| NVNT      | n40  | 5190            | Ant2    | 84.89          | 0.71                   | 1.75      |
| NVNT      | n40  | 5230            | Ant2    | 84.89          | 0.71                   | 1.75      |
| NVNT      | ac20 | 5180            | Ant2    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ac20 | 5200            | Ant2    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ac20 | 5240            | Ant2    | 91.95          | 0.36                   | 0.87      |
| NVNT      | ac40 | 5190            | Ant2    | 84.98          | 0.71                   | 1.73      |
| NVNT      | ac40 | 5230            | Ant2    | 84.98          | 0.71                   | 1.73      |
| NVNT      | ac80 | 5210            | Ant2    | 73.91          | 1.31                   | 3.46      |
| NVNT      | ax20 | 5180            | Ant2    | 90.63          | 0.43                   | 1.01      |
| NVNT      | ax20 | 5200            | Ant2    | 90.73          | 0.42                   | 1.01      |
| NVNT      | ax20 | 5240            | Ant2    | 90.73          | 0.42                   | 1.01      |
| NVNT      | ax40 | 5190            | Ant2    | 83.63          | 0.78                   | 1.92      |
| NVNT      | ax40 | 5230            | Ant2    | 83.76          | 0.77                   | 1.92      |
| NVNT      | ax80 | 5210            | Ant2    | 73.3           | 1.35                   | 3.57      |






## Test Graphs

## Duty Cycle NVNT a 5180MHz Ant2

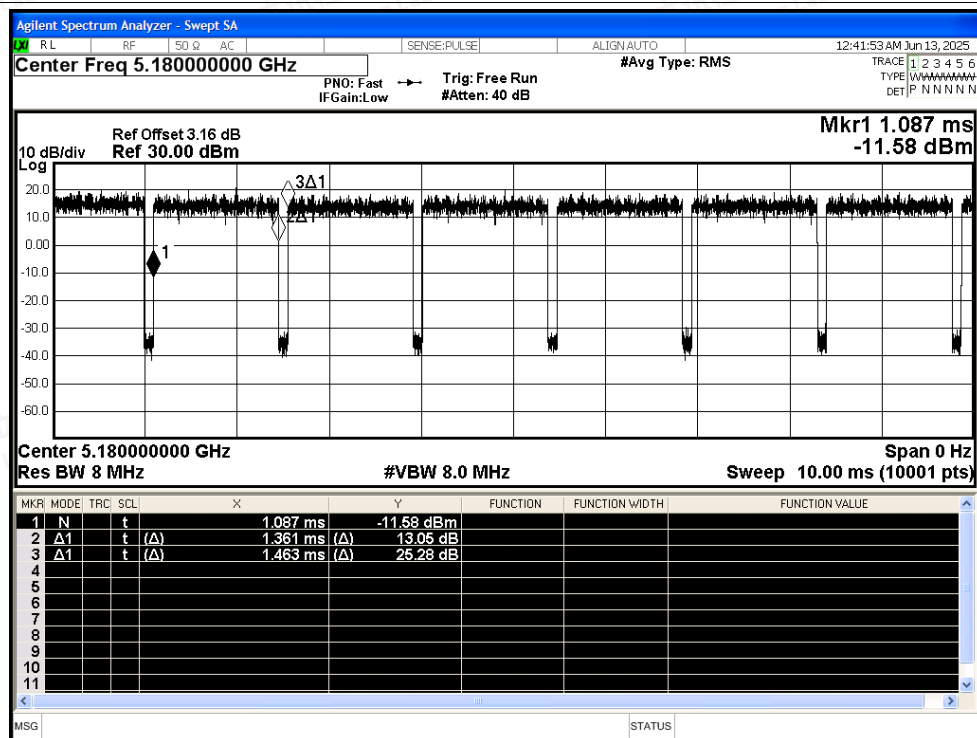

## Duty Cycle NVNT a 5200MHz Ant2

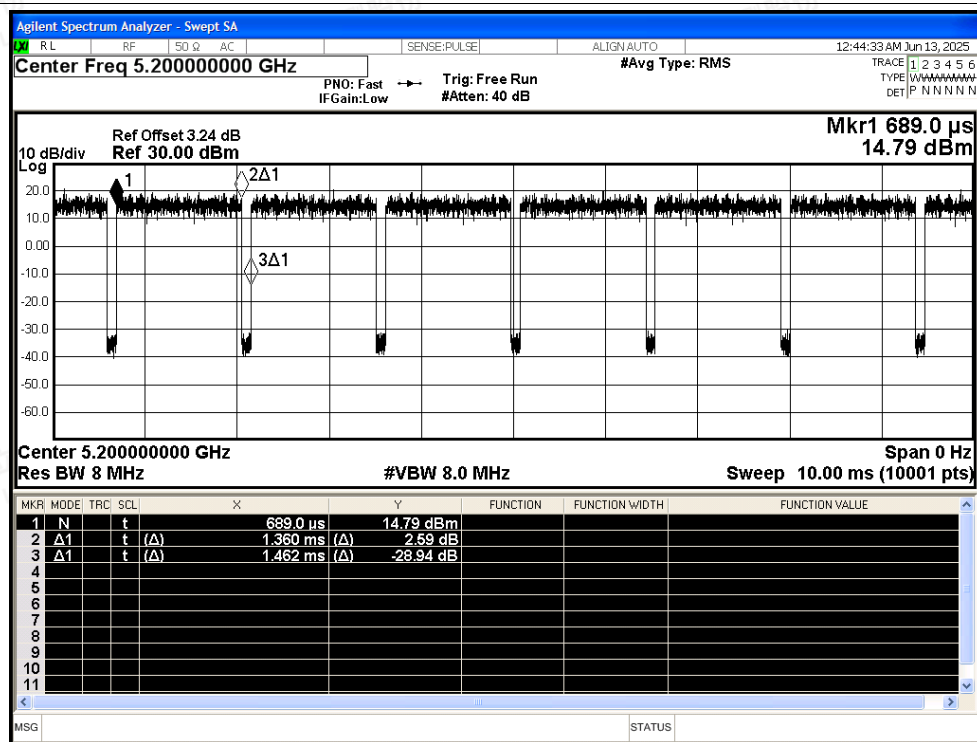

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5240MHz Ant2

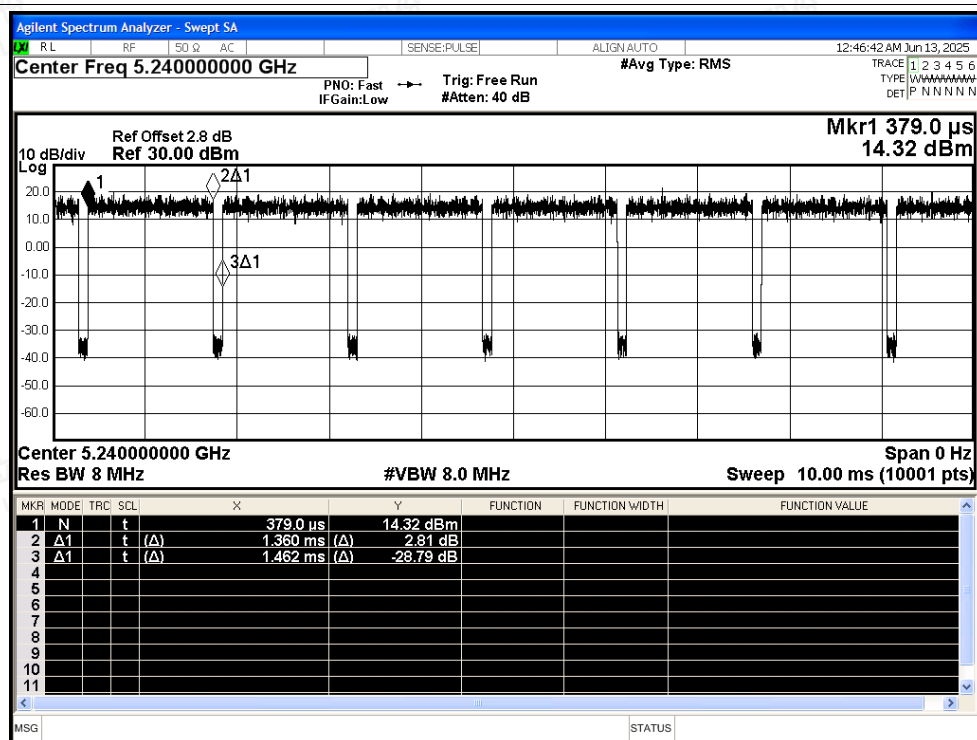

## Duty Cycle NVNT n20 5180MHz Ant2

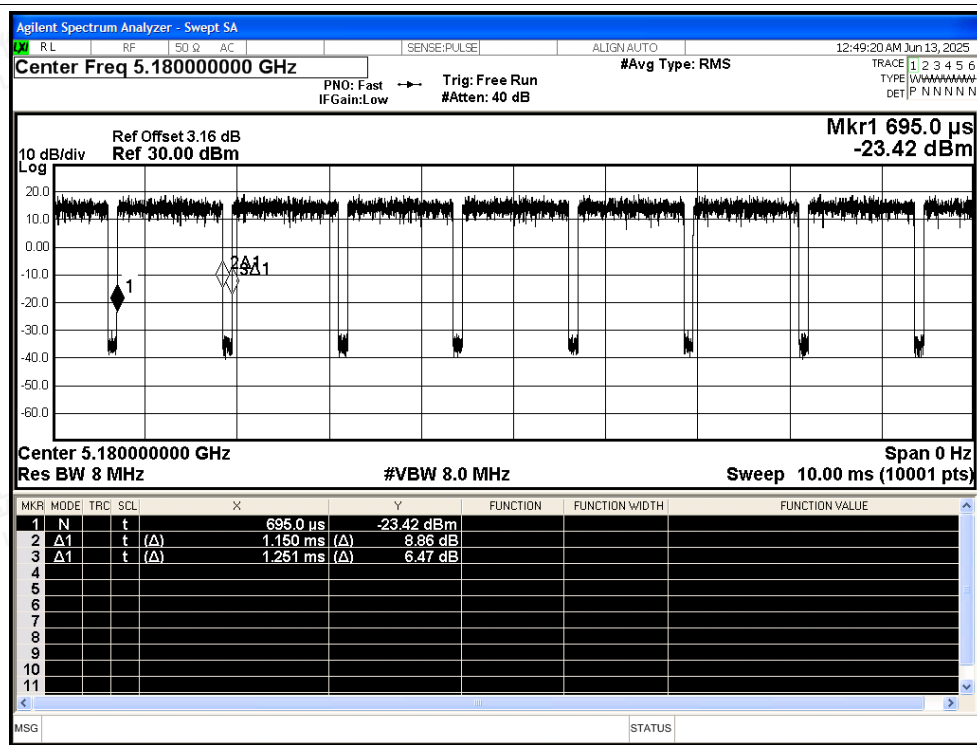

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n20 5200MHz Ant2

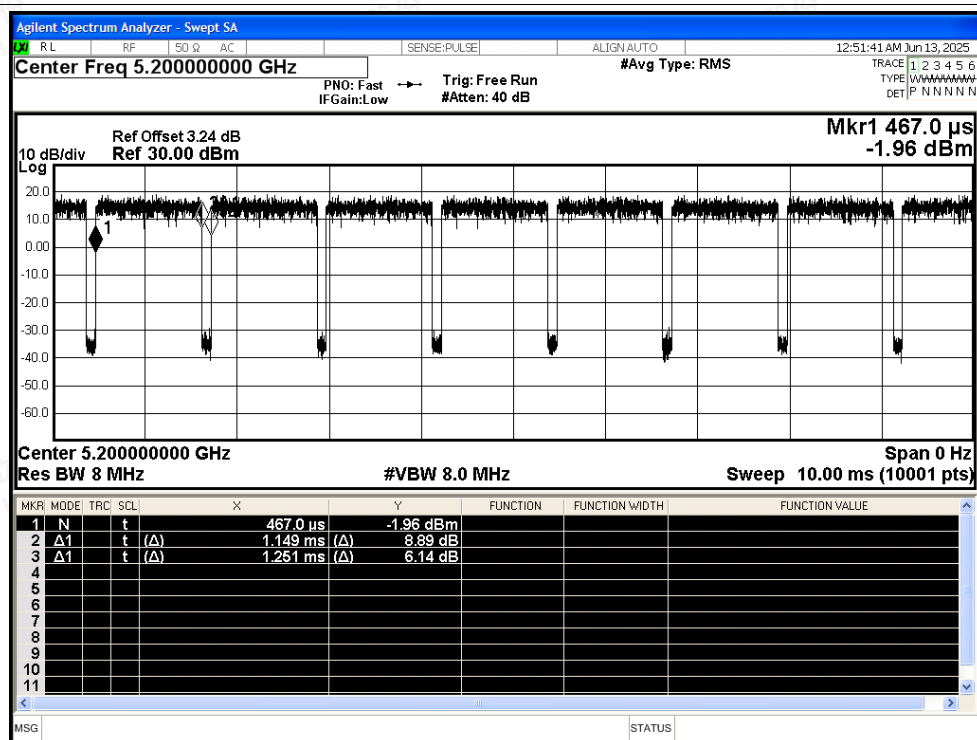

## Duty Cycle NVNT n20 5240MHz Ant2

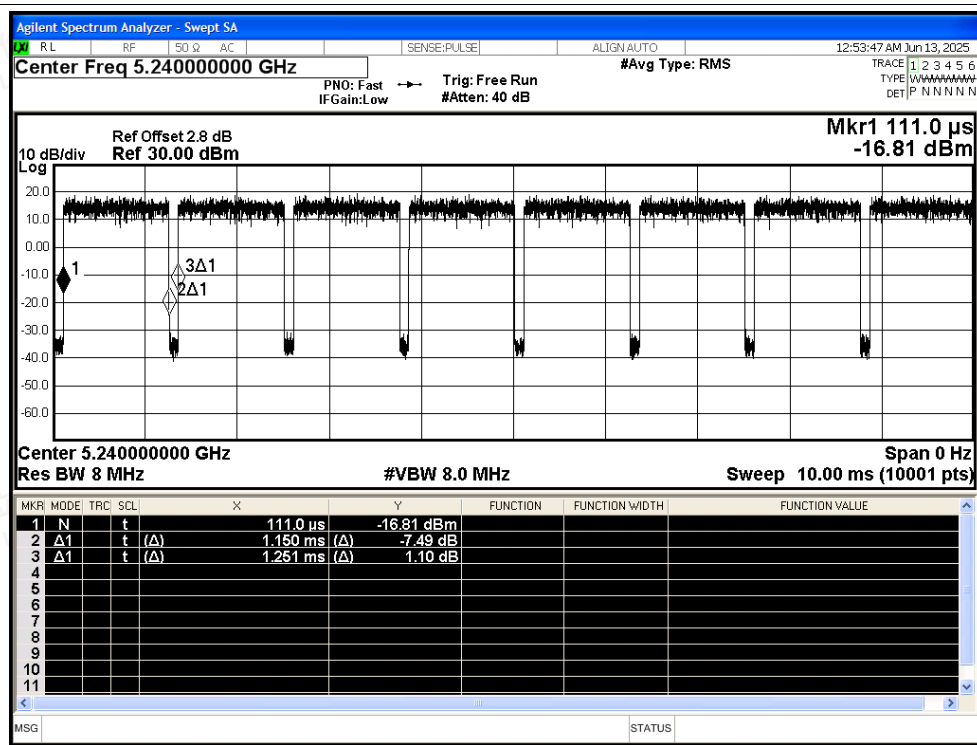

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5190MHz Ant2

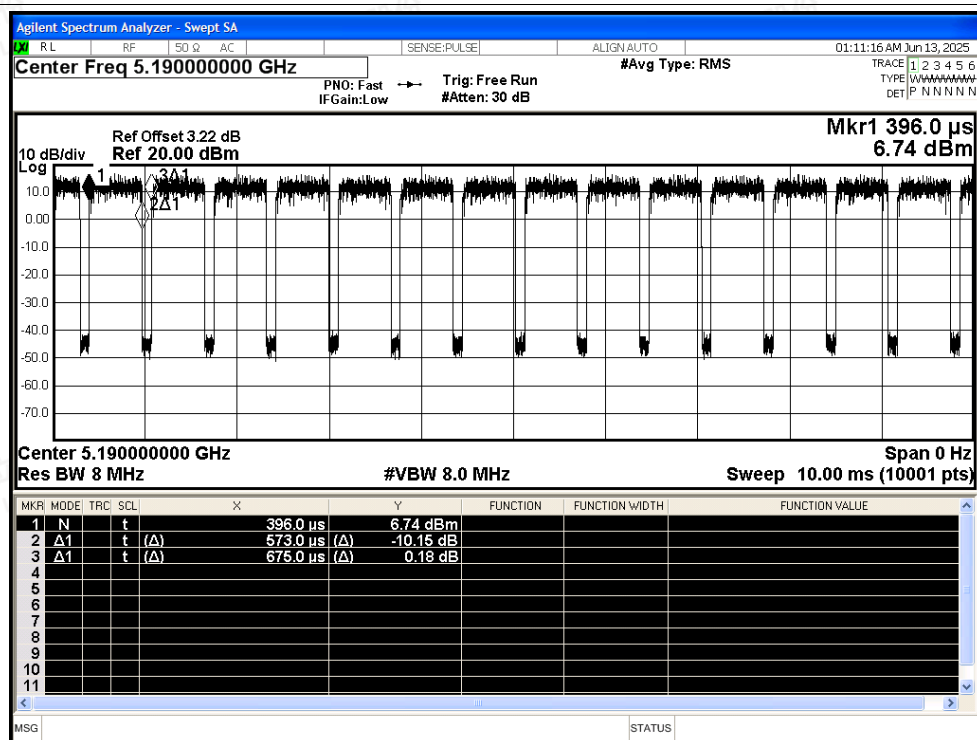

## Duty Cycle NVNT n40 5230MHz Ant2

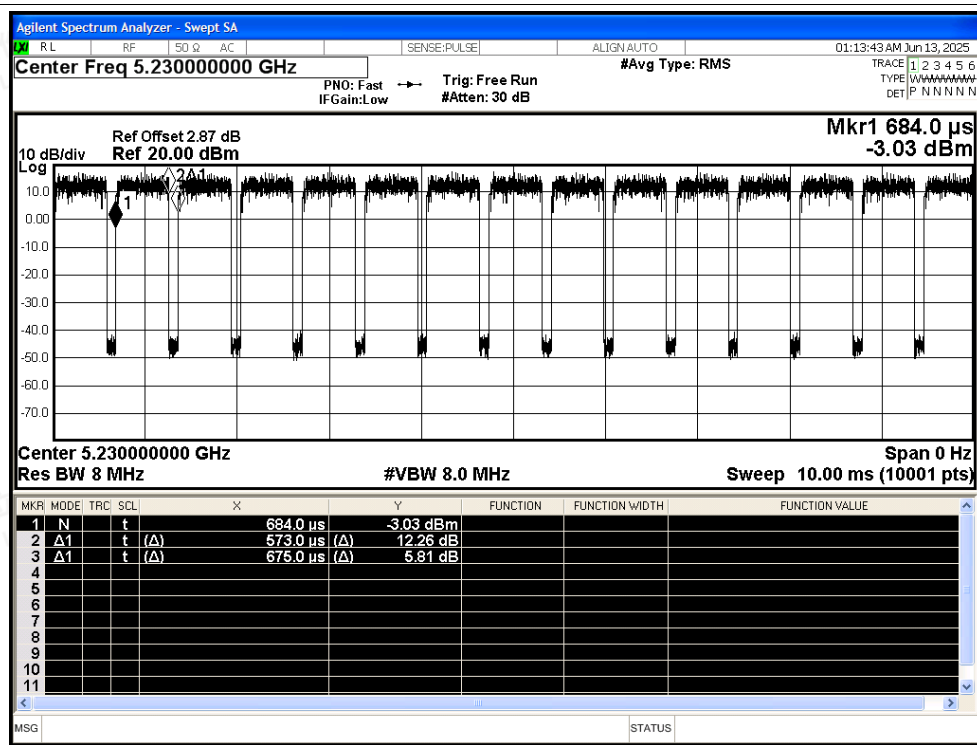

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5180MHz Ant2

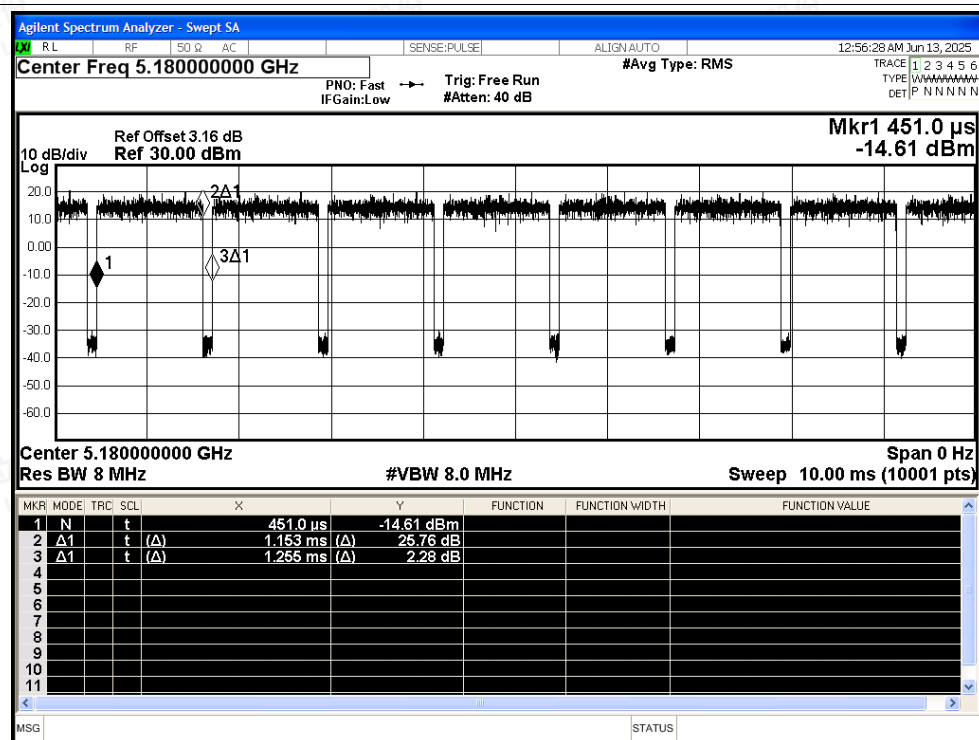

## Duty Cycle NVNT ac20 5200MHz Ant2

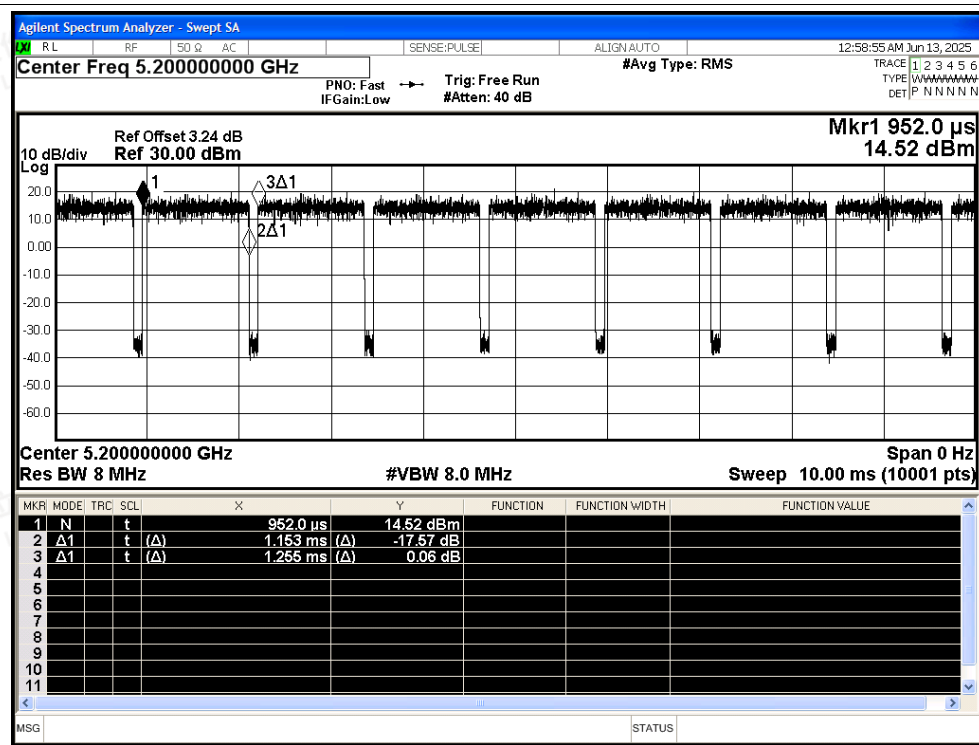

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5240MHz Ant2

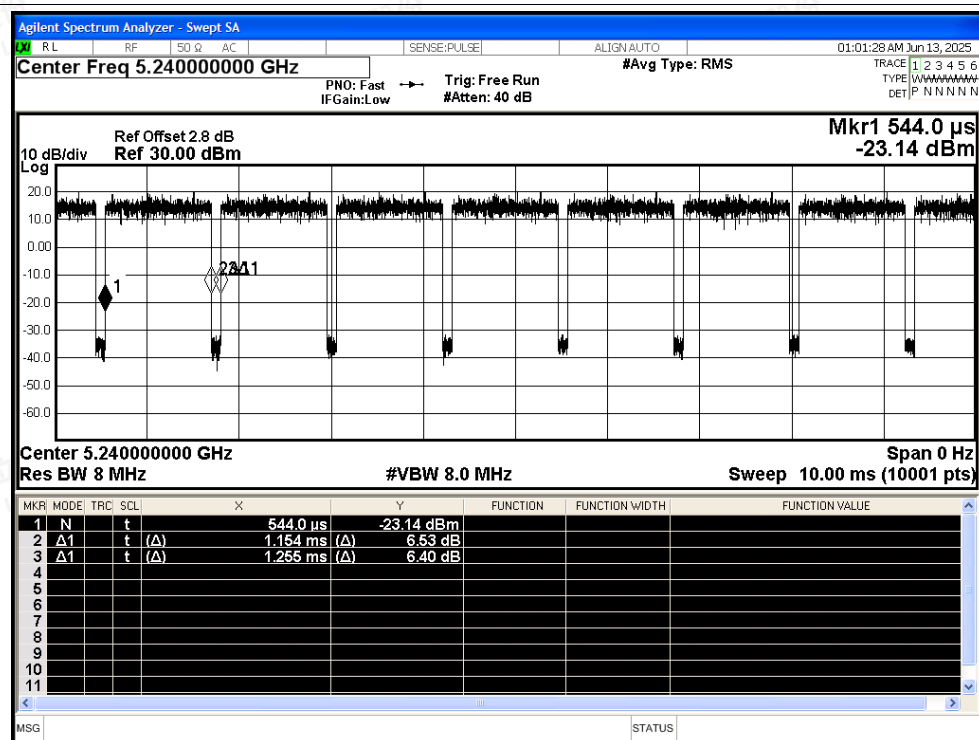

## Duty Cycle NVNT ac40 5190MHz Ant2

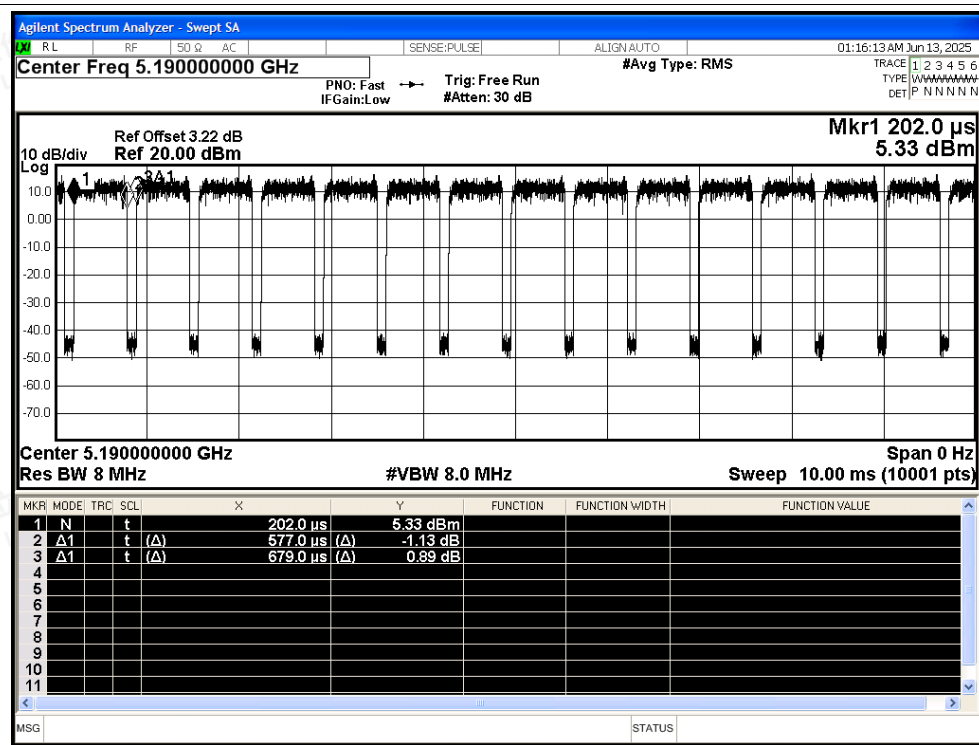

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5230MHz Ant2

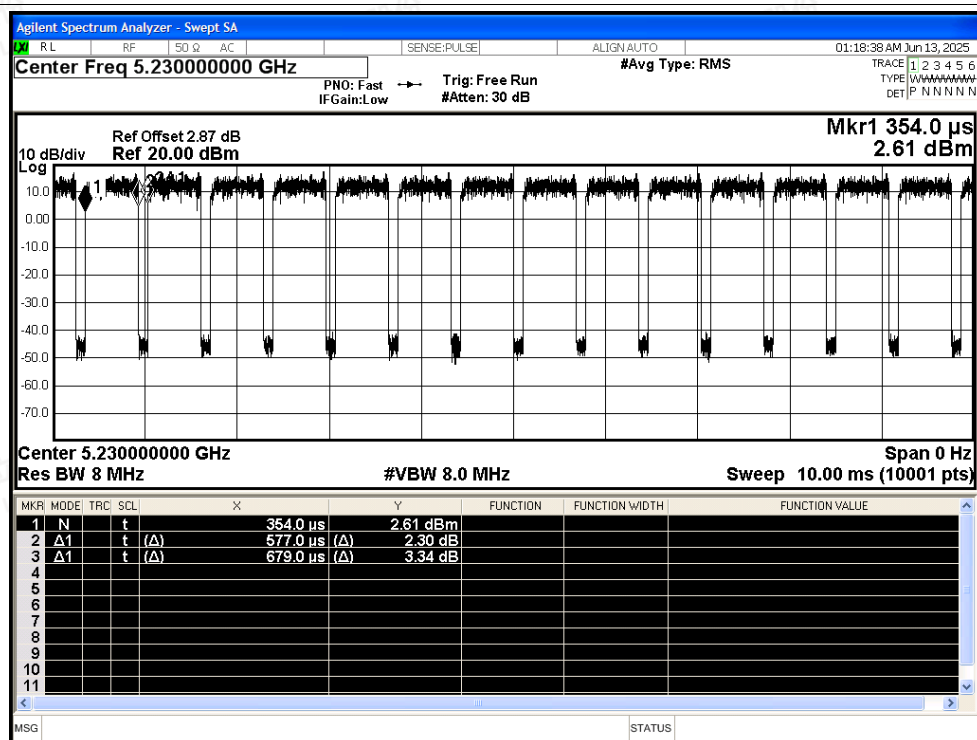

## Duty Cycle NVNT ac80 5210MHz Ant2

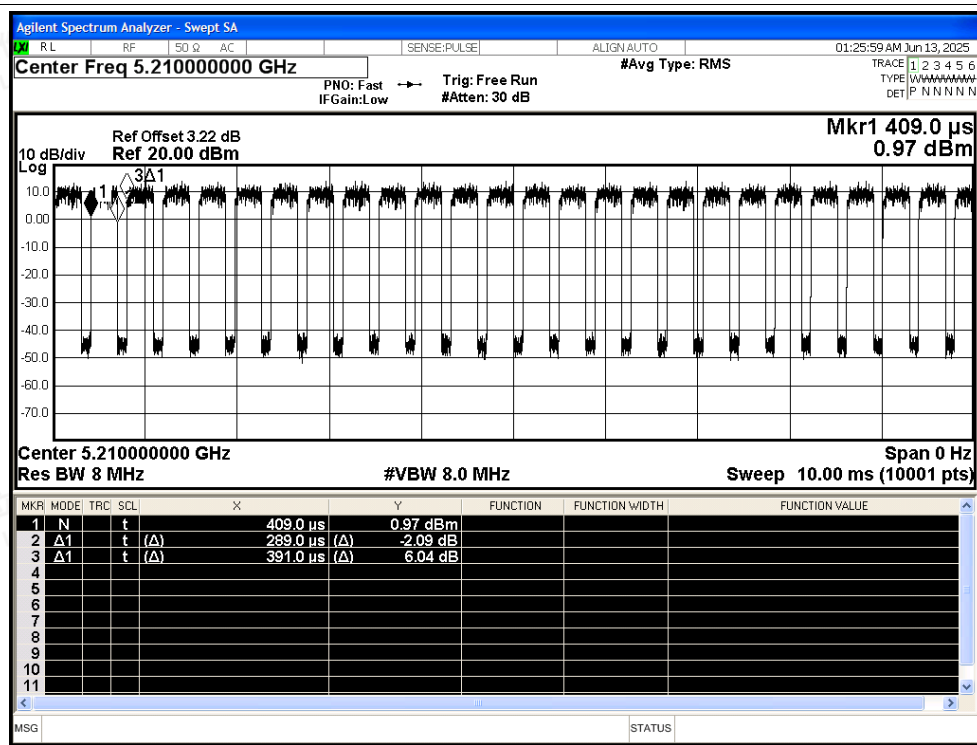

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5180MHz Ant2

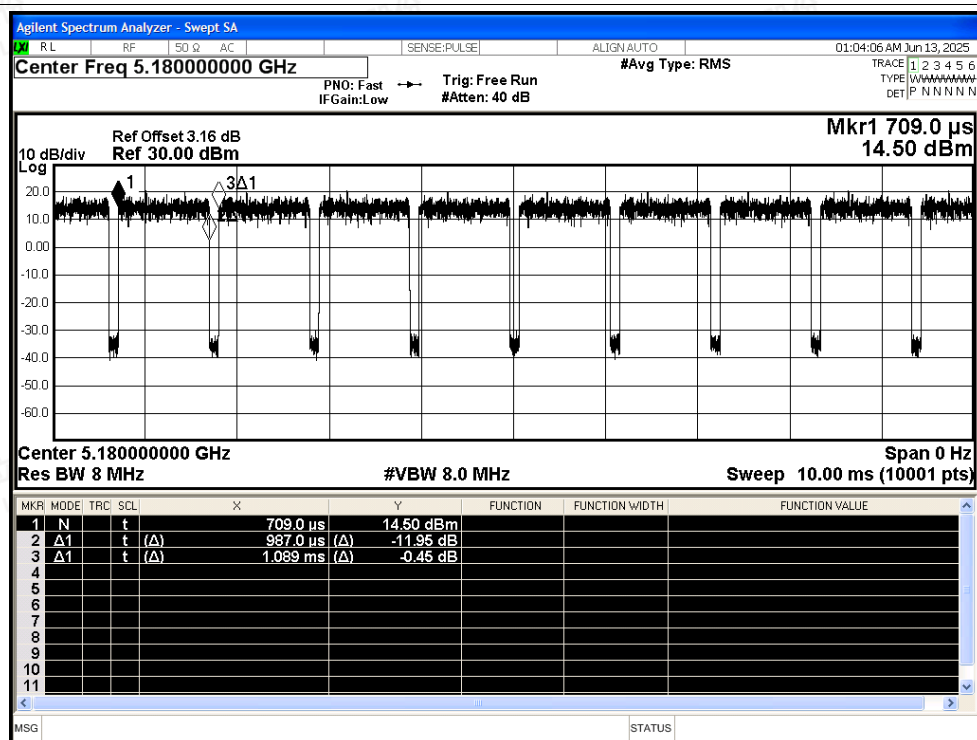

## Duty Cycle NVNT ax20 5200MHz Ant2

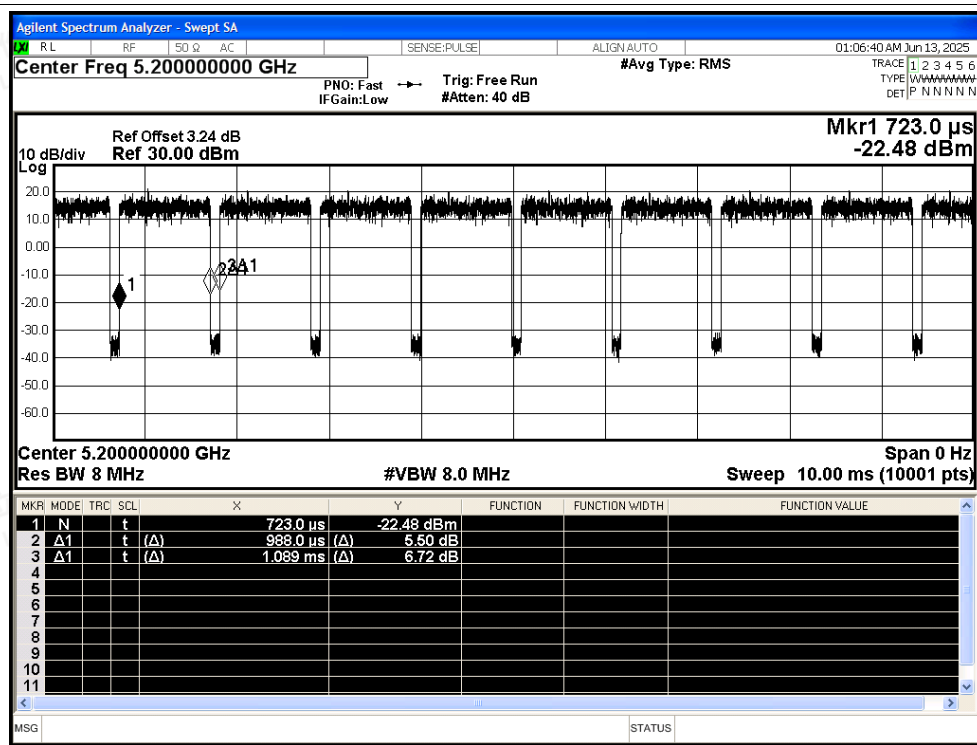

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5240MHz Ant2

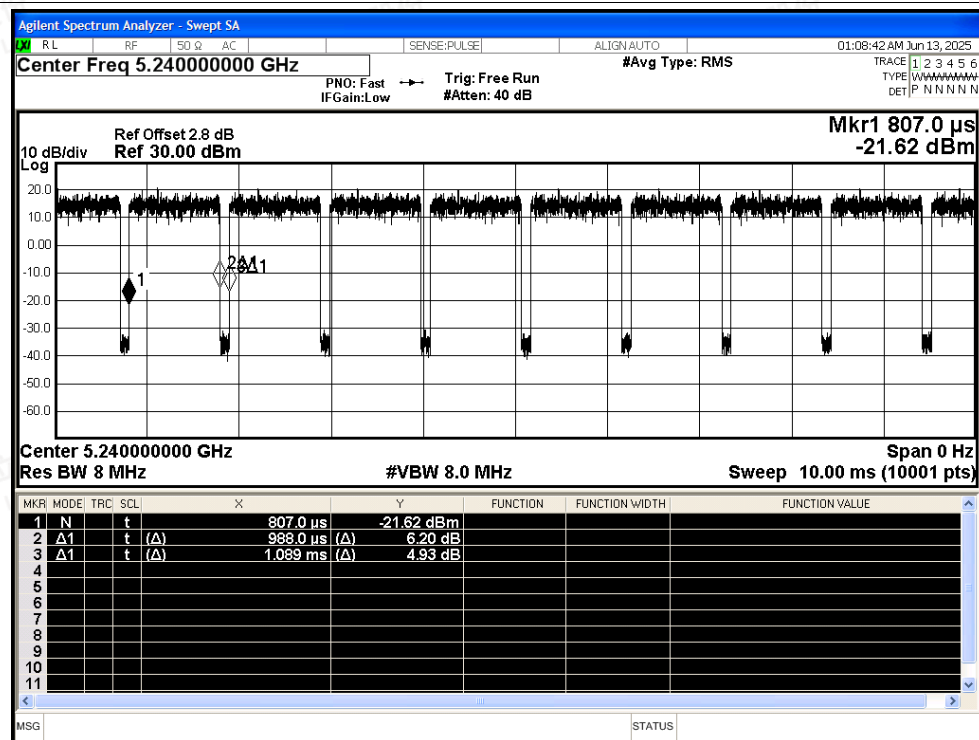

## Duty Cycle NVNT ax40 5190MHz Ant2

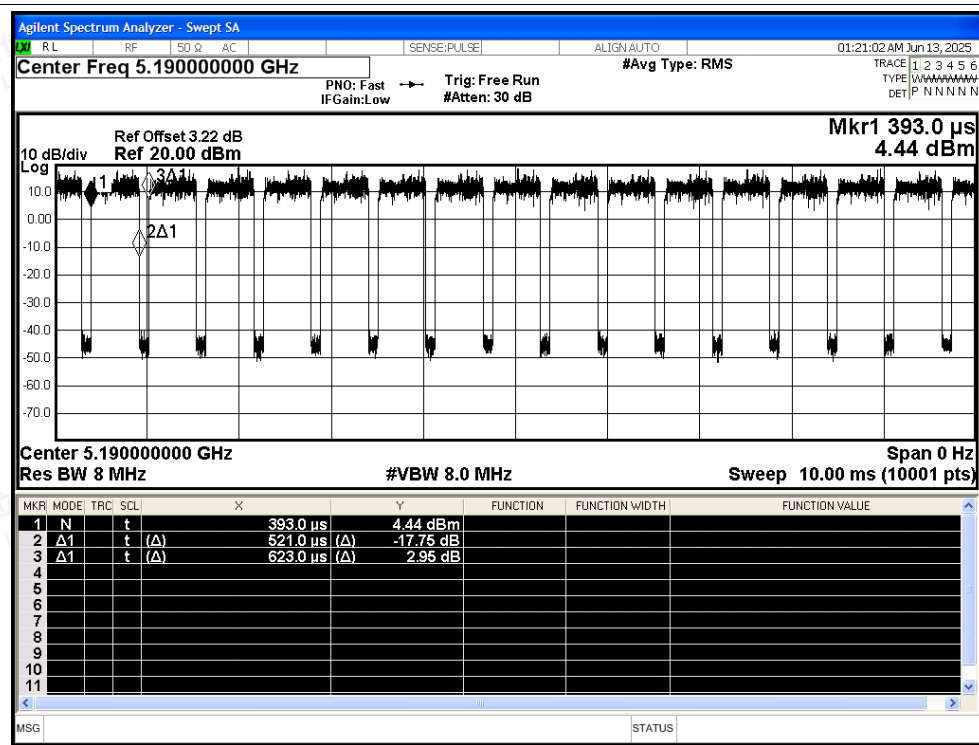

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5230MHz Ant2

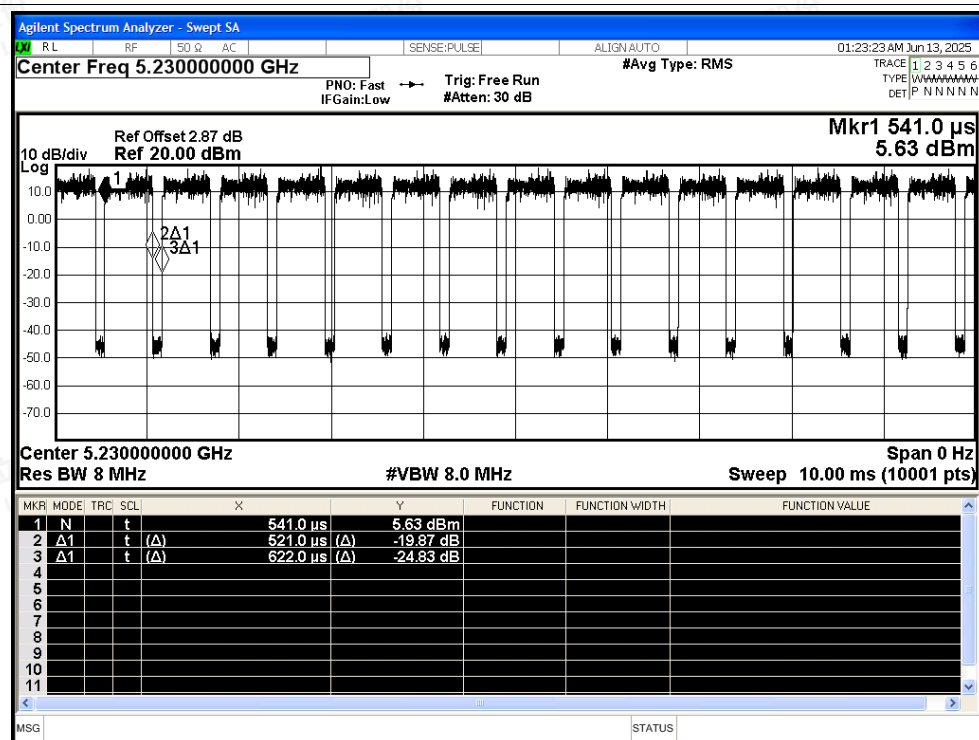

## Duty Cycle NVNT ax80 5210MHz Ant2

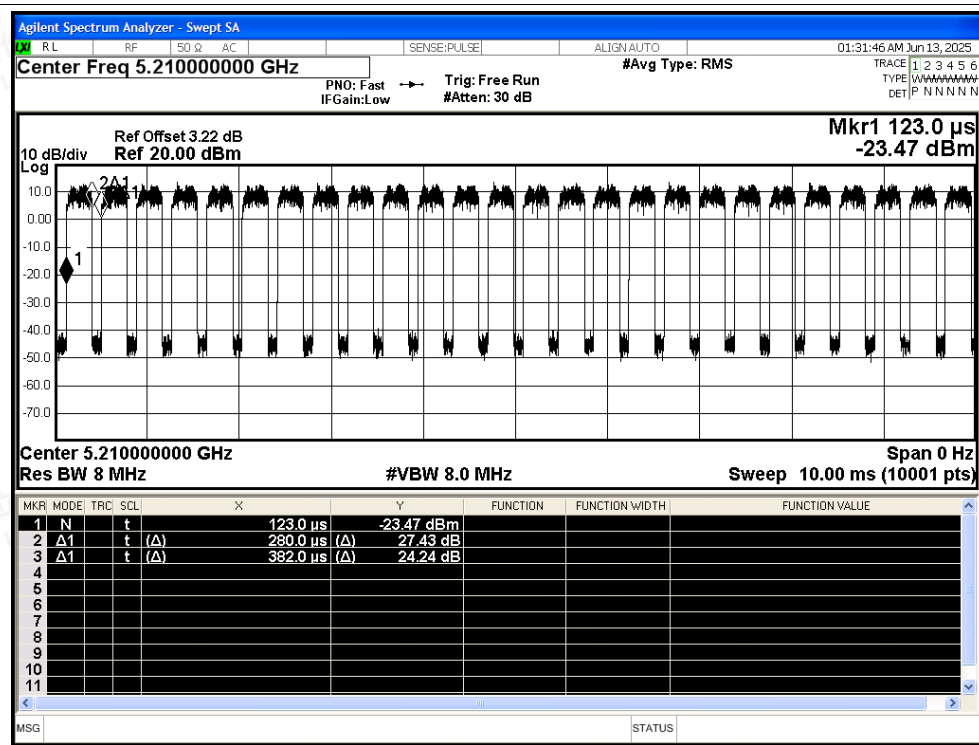

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity