




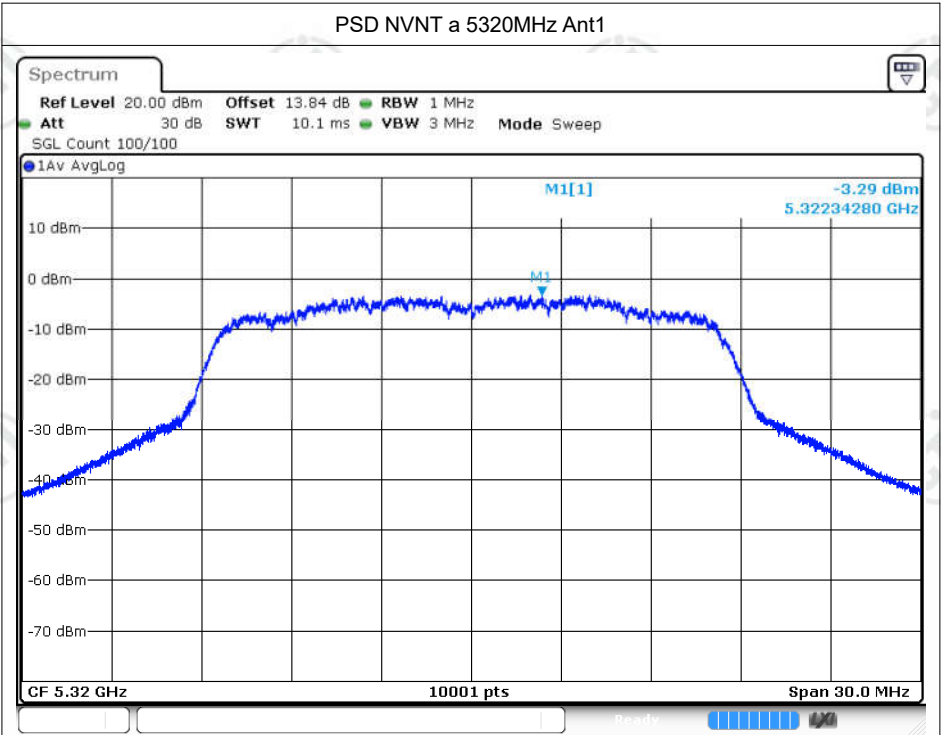


Date: 4.JAN.2025 13:40:56

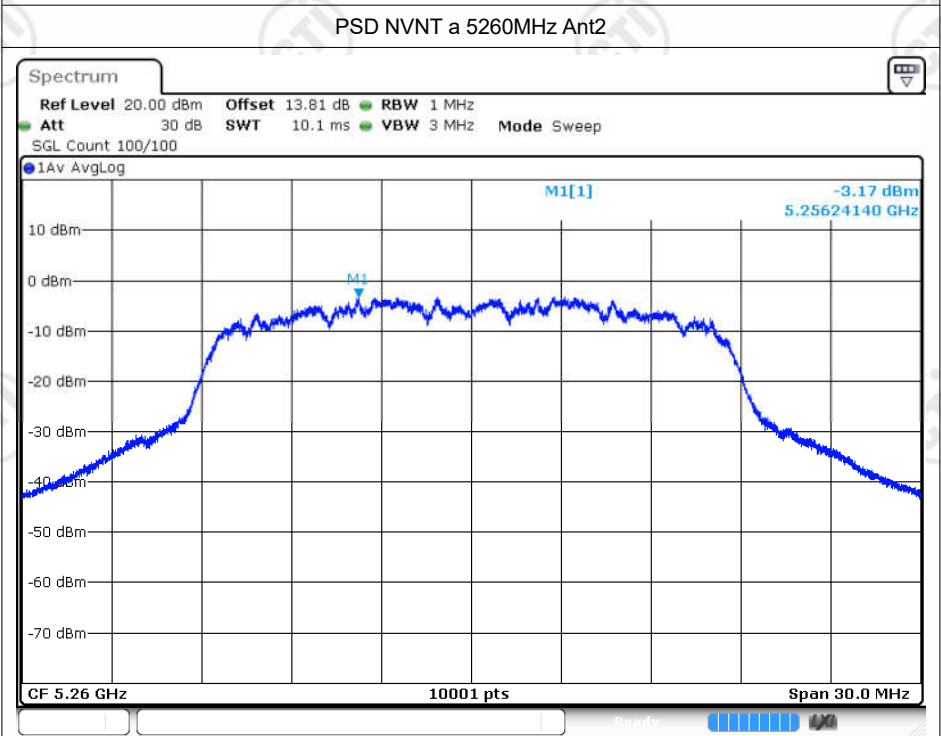


Date: 4.JAN.2025 14:06:20

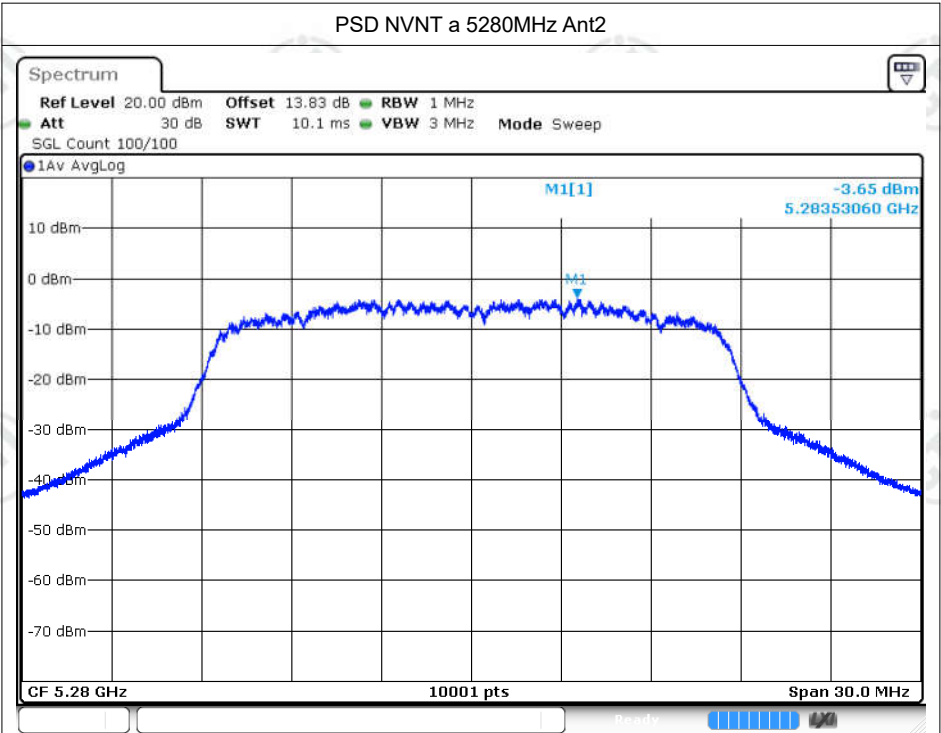


Date: 4.JAN.2025 14:07:55

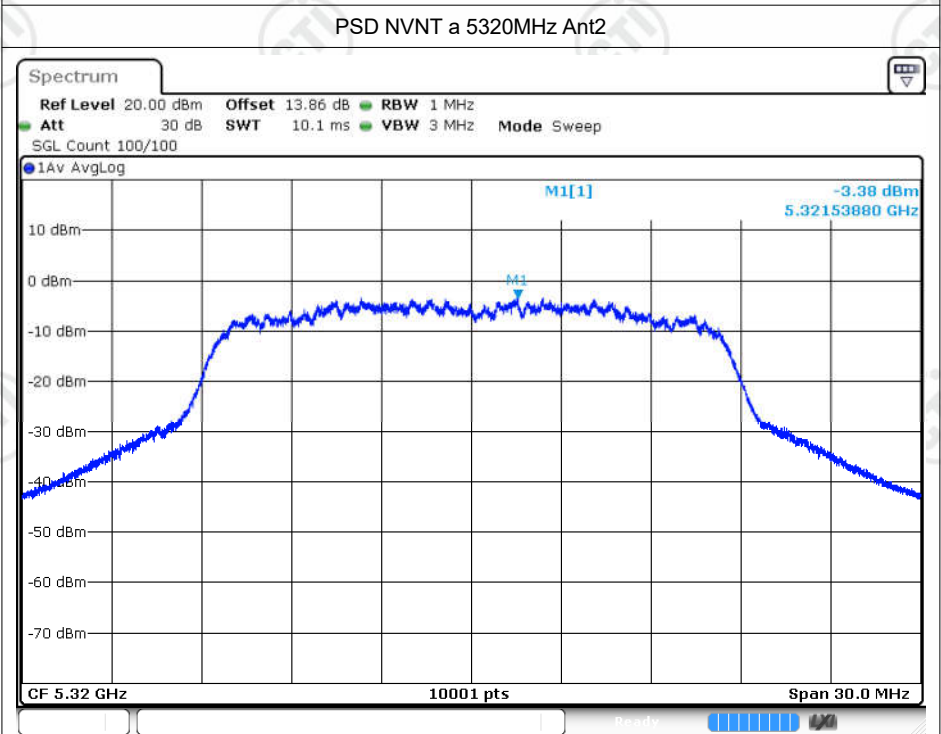


Date: 4.JAN.2025 14:09:35

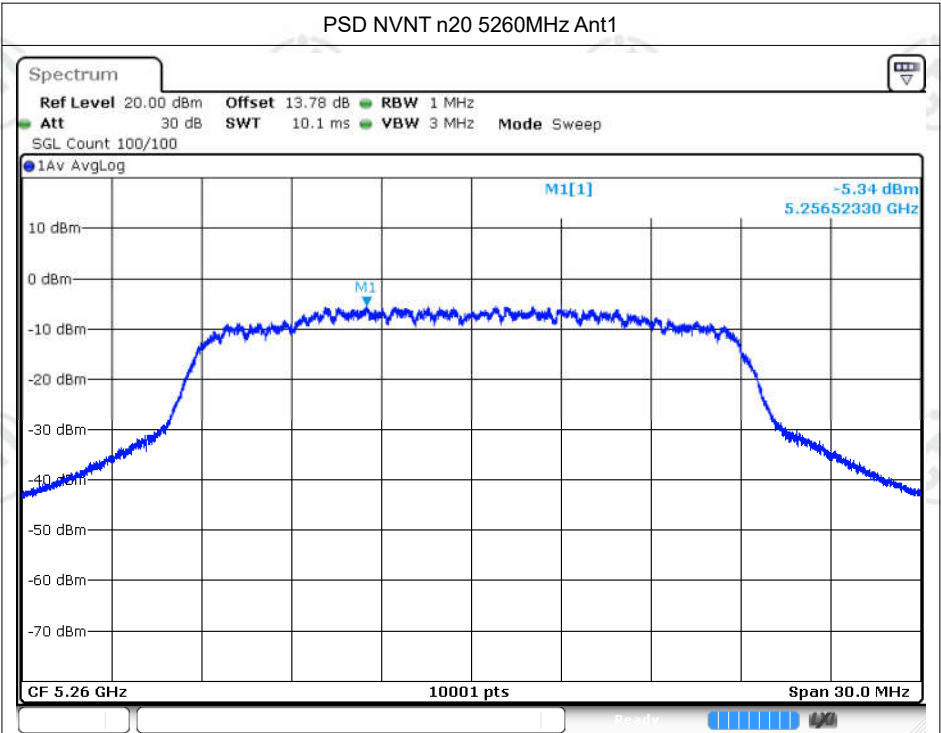


Date: 4.JAN.2025 13:42:57

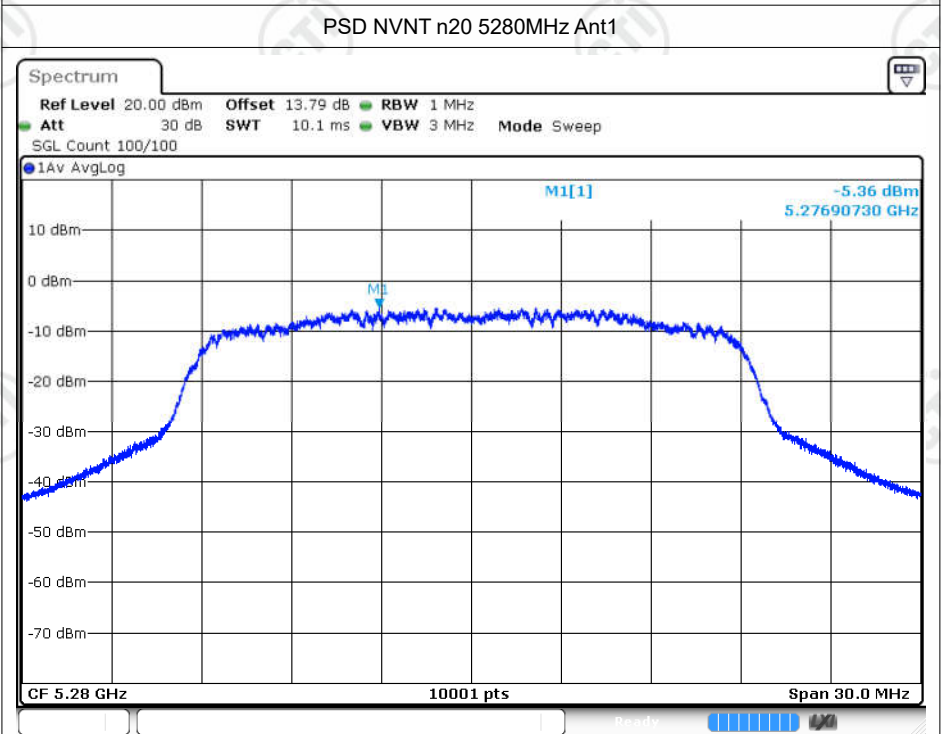


Date: 4.JAN.2025 13:44:27

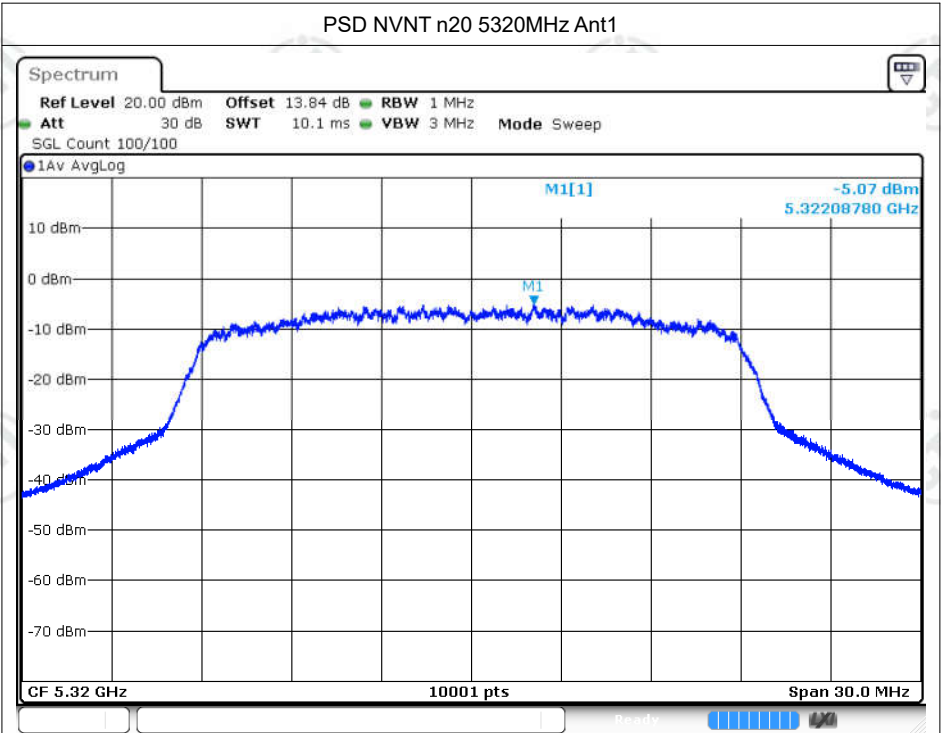


Date: 4.JAN.2025 13:45:46

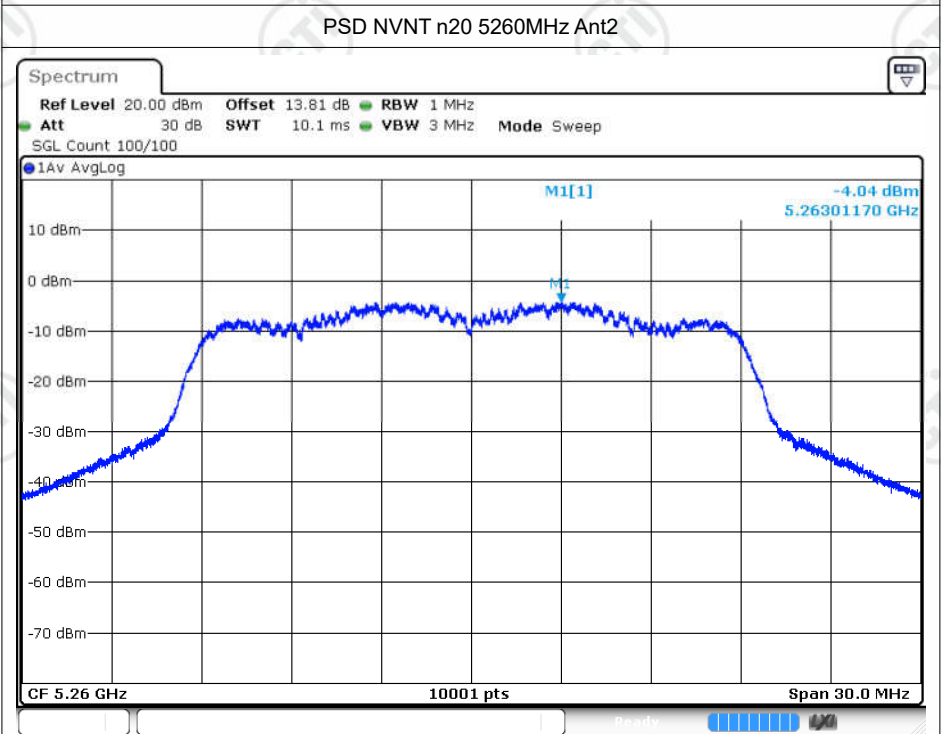


Date: 4.JAN.2025 14:15:30

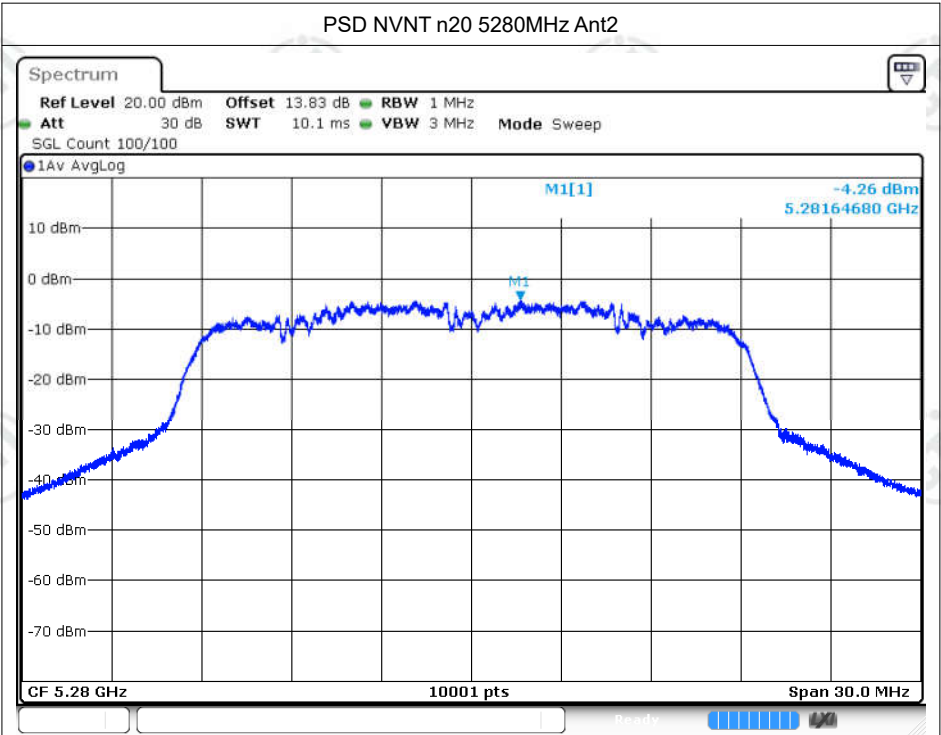


Date: 4.JAN.2025 14:16:57

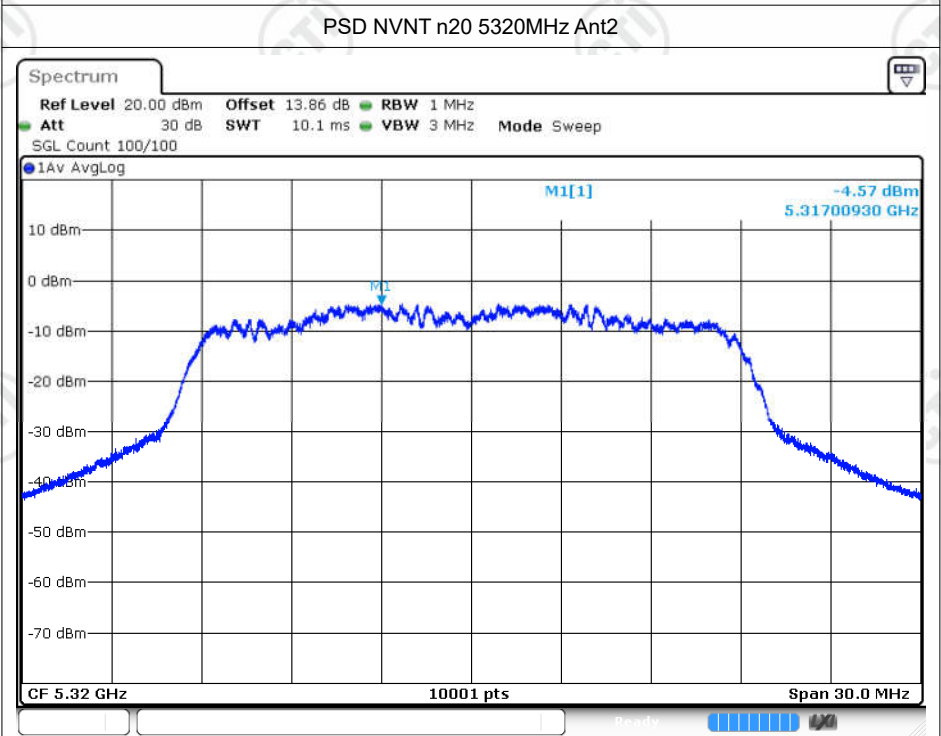


Date: 4.JAN.2025 14:18:25

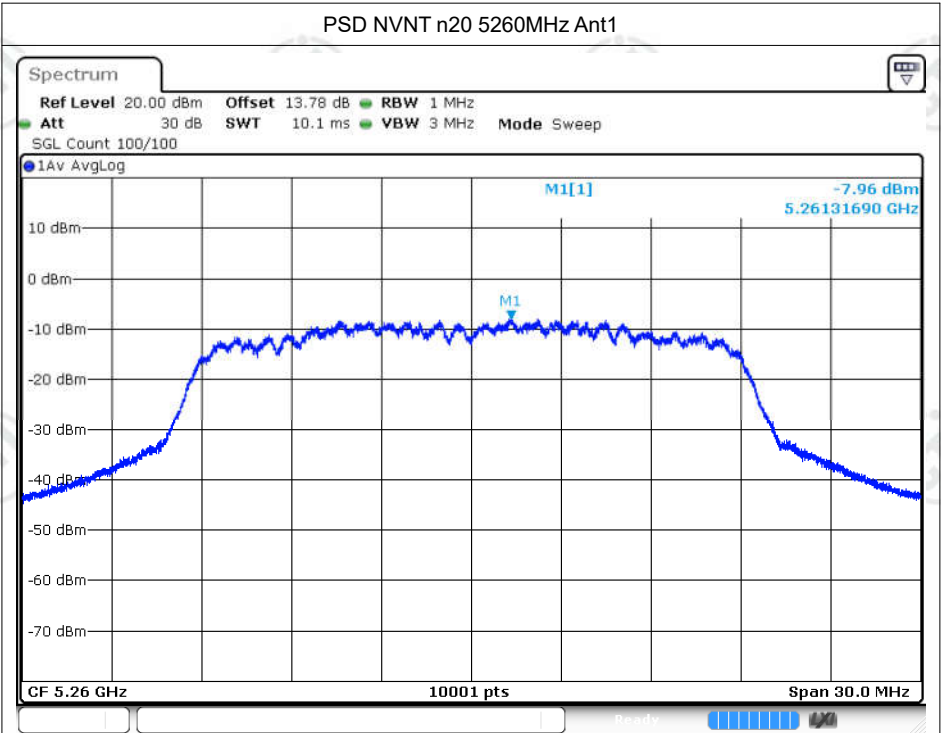


Date: 4.JAN.2025 14:53:48

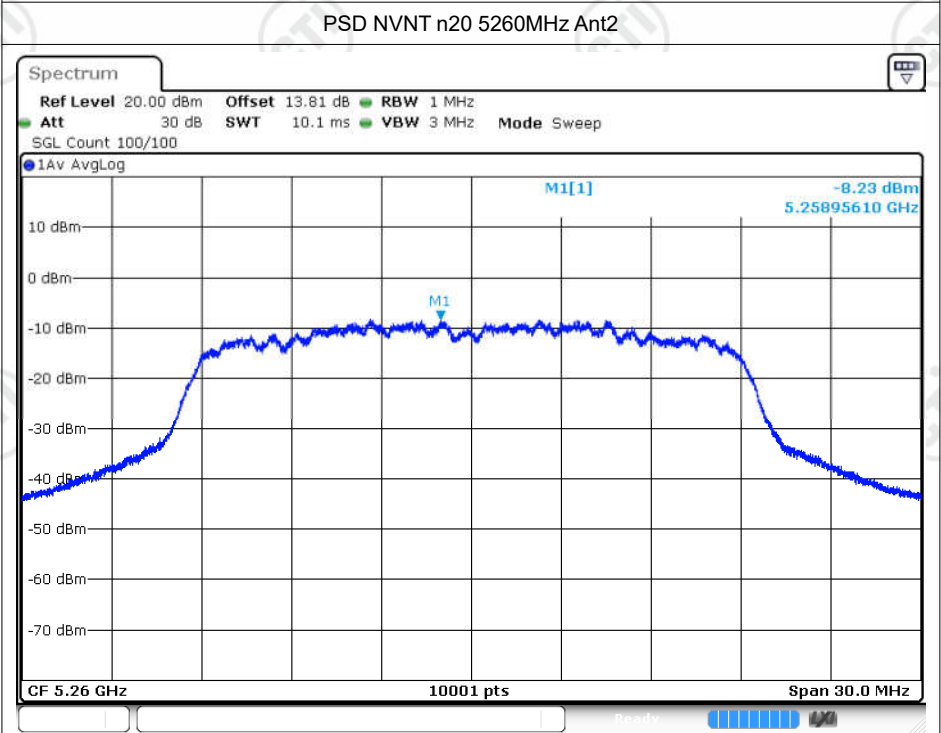


Date: 4.JAN.2025 14:53:51

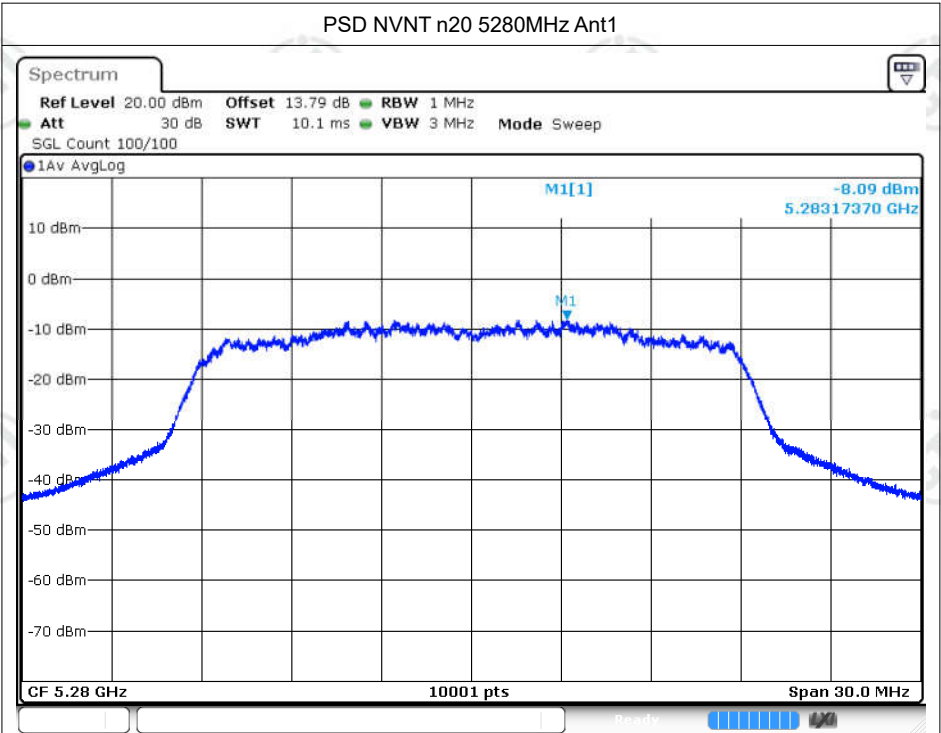


Date: 4.JAN.2025 14:54:22

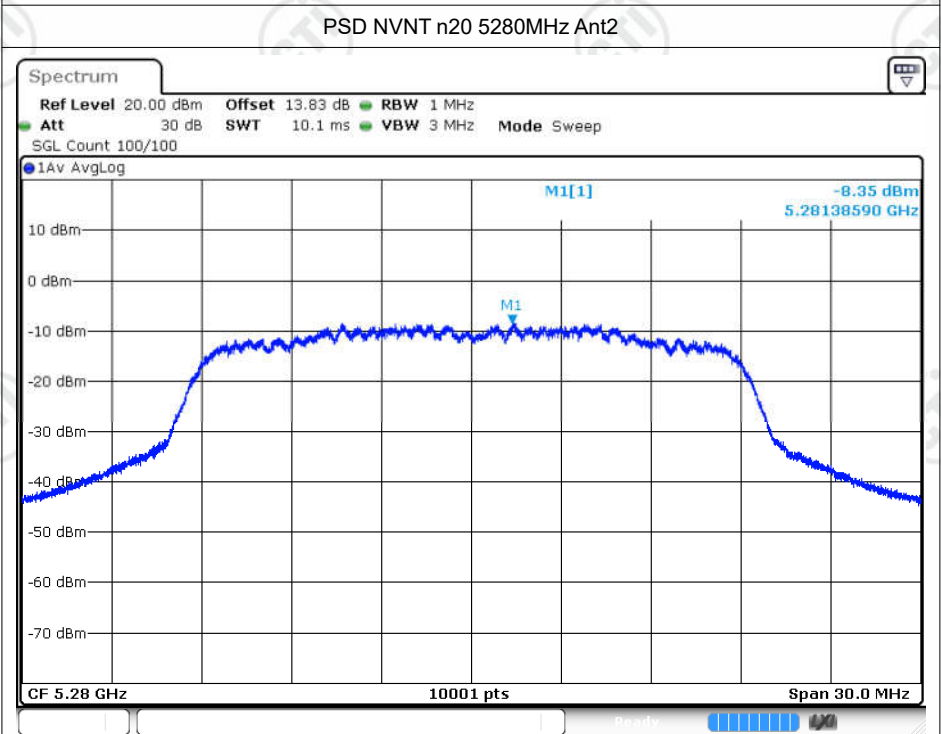


Date: 4.JAN.2025 14:54:25

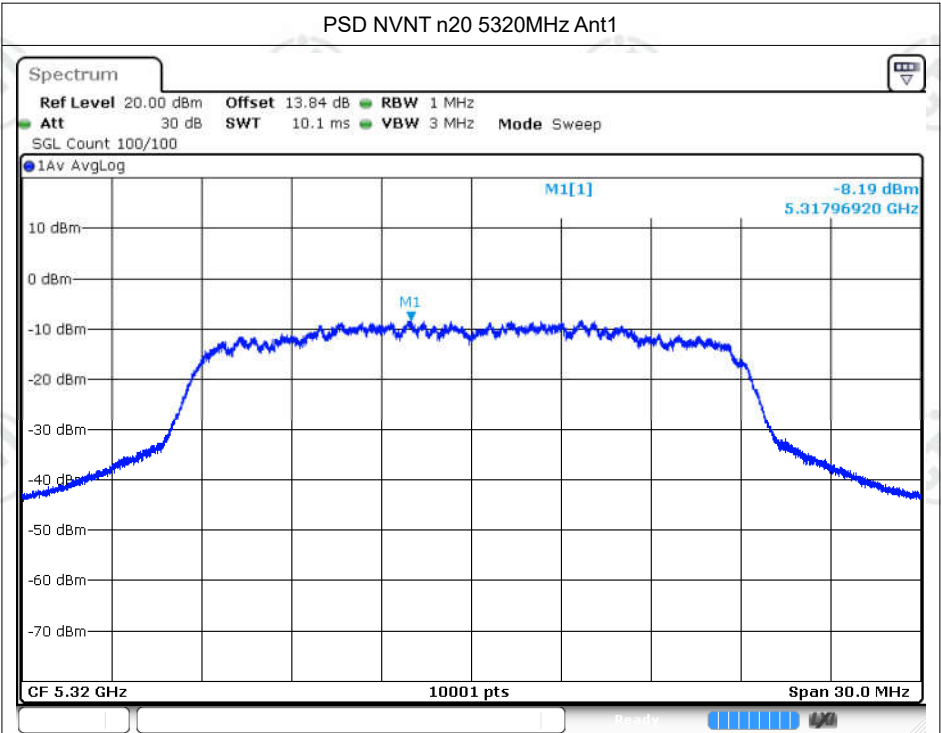


Date: 4.JAN.2025 14:55:08

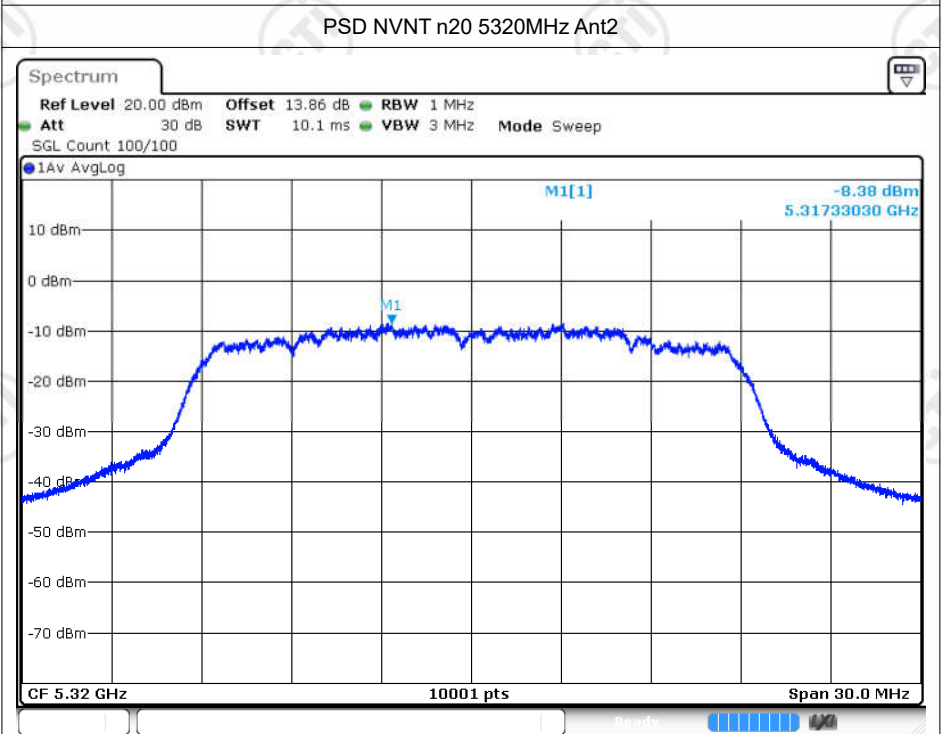


Date: 4.JAN.2025 14:55:12

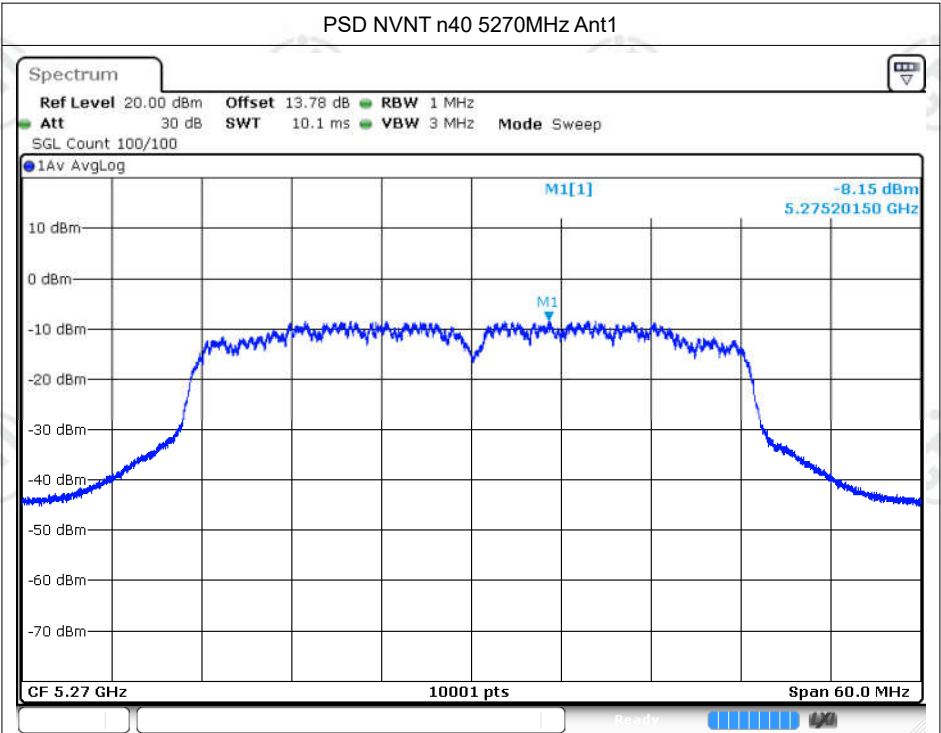


Date: 4.JAN.2025 13:53:34

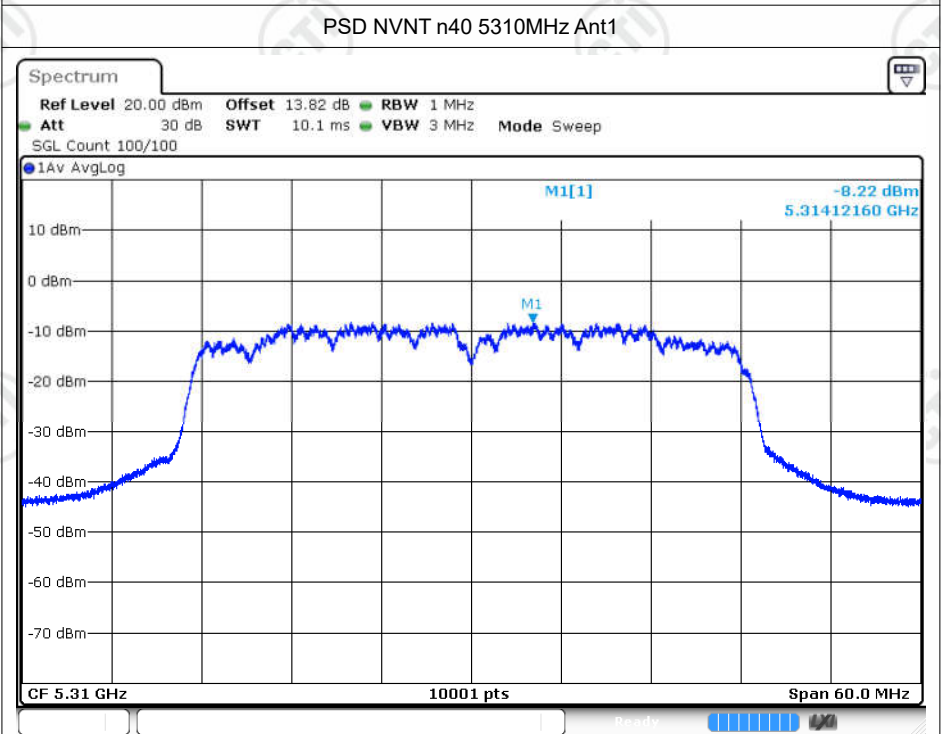


Date: 4.JAN.2025 13:55:15

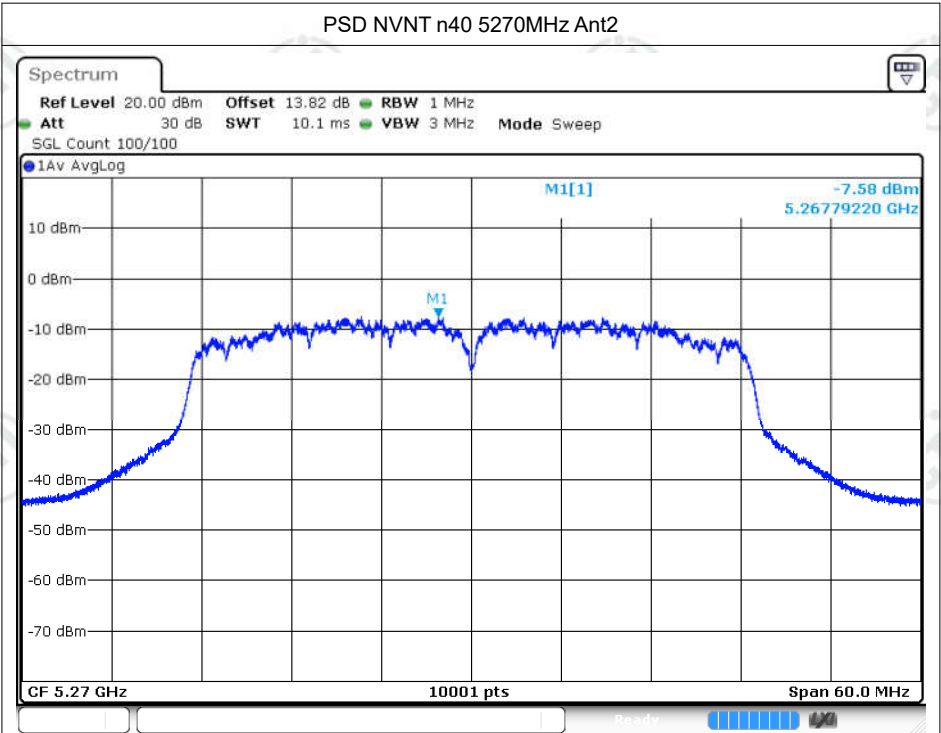


Date: 4.JAN.2025 14:25:46

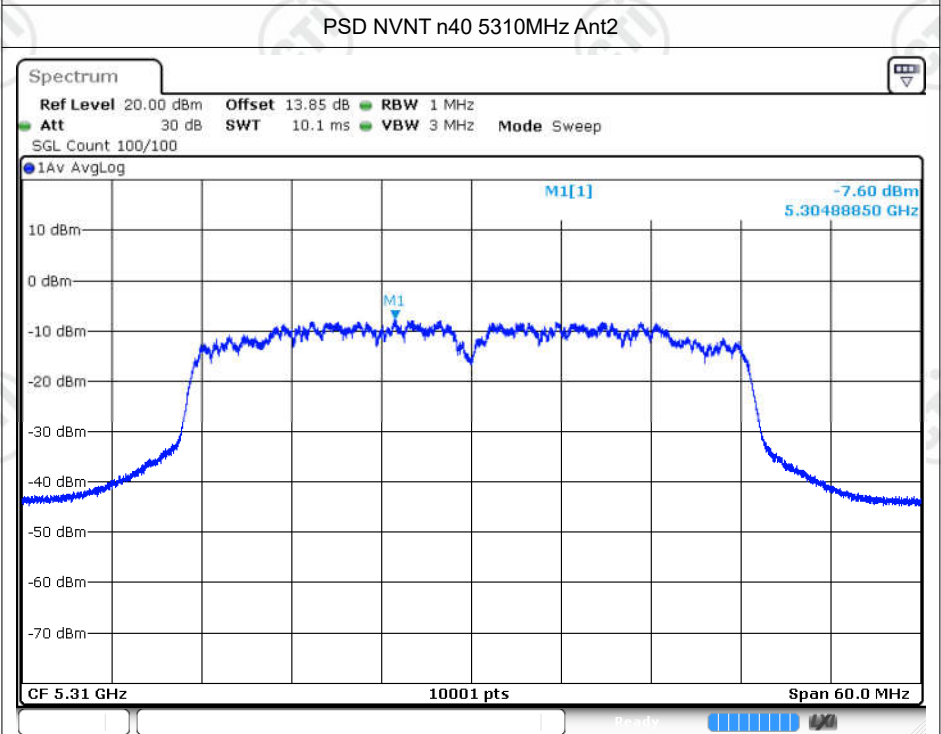


Date: 4.JAN.2025 14:28:10

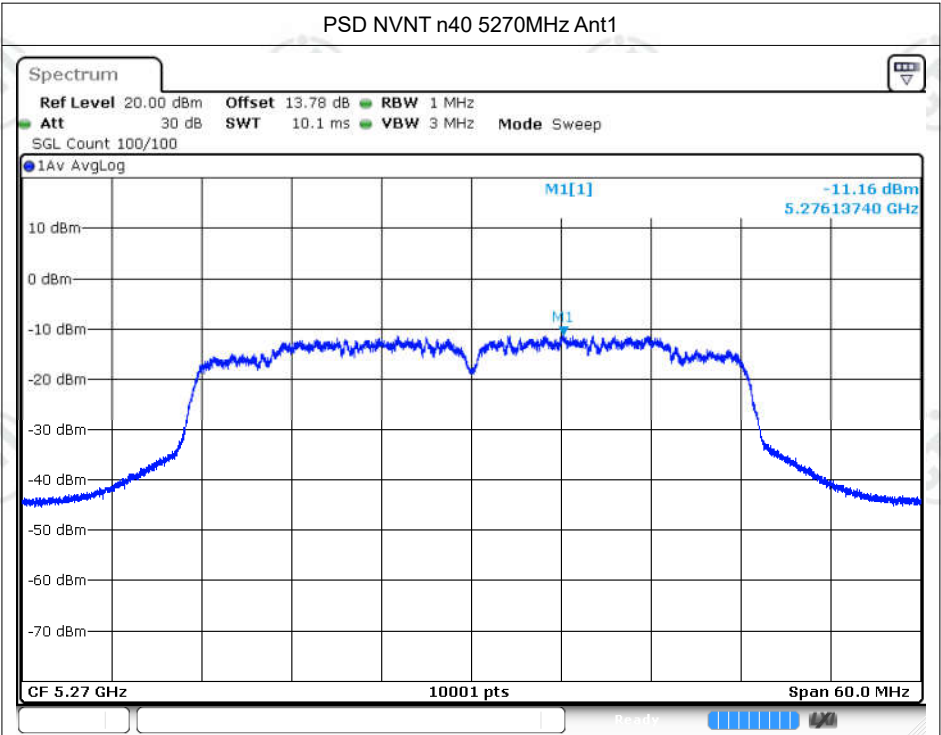


Date: 4.JAN.2025 15:00:30

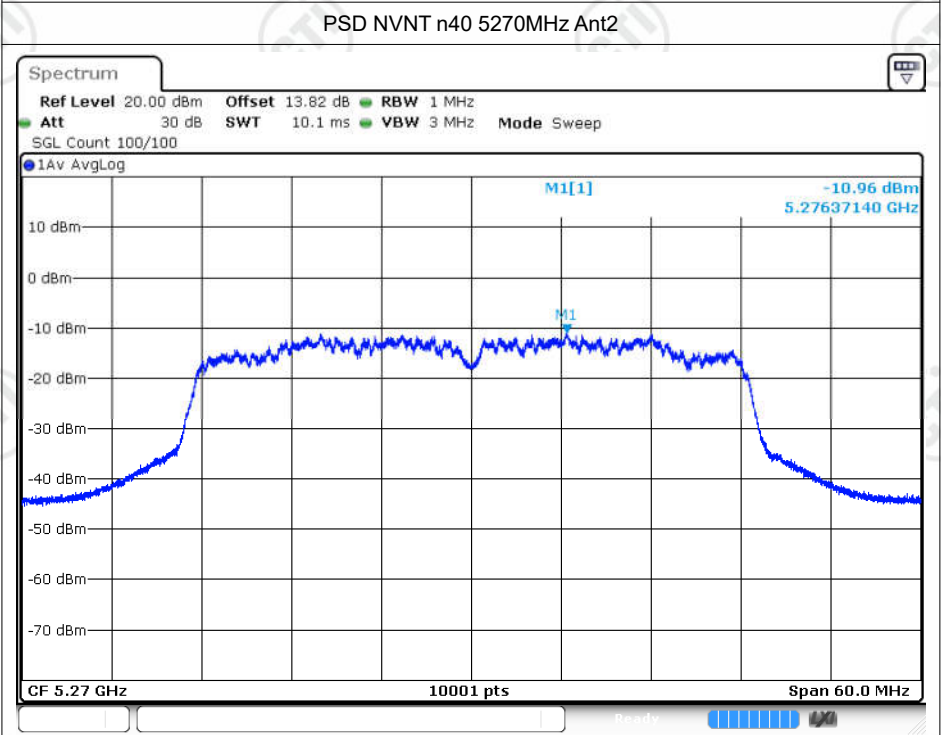


Date: 4.JAN.2025 15:00:33

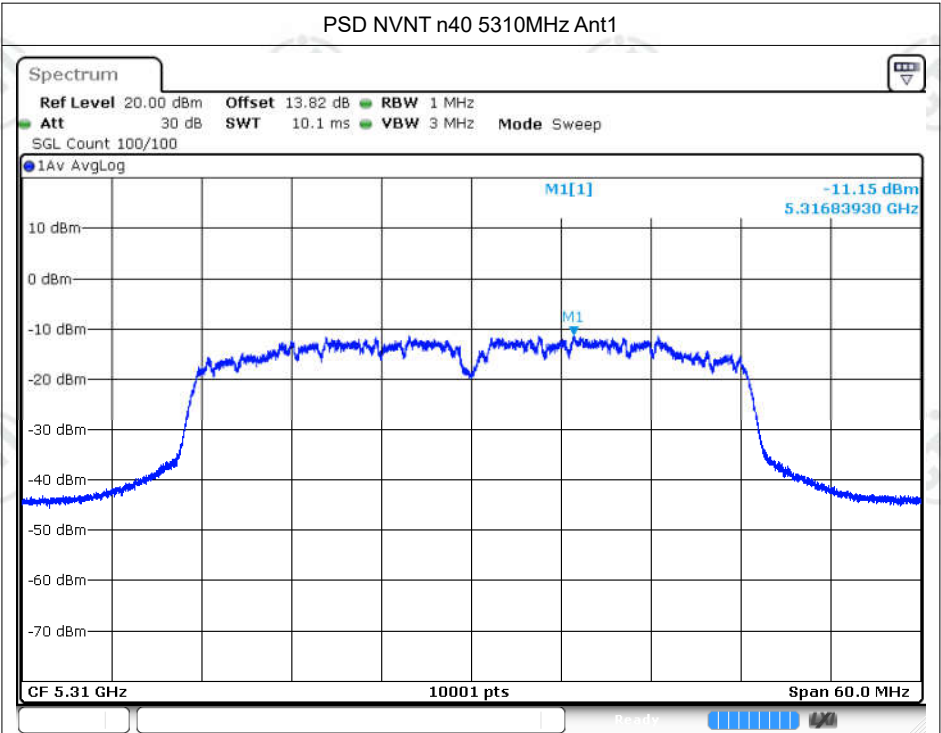


Date: 4.JAN.2025 15:18:07

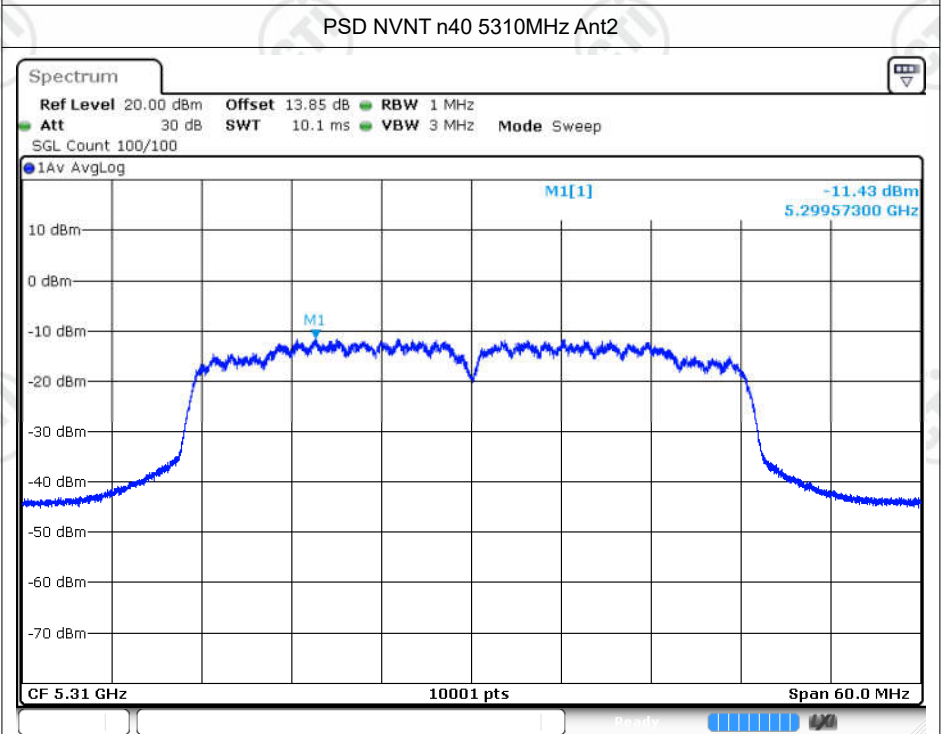


Date: 4.JAN.2025 15:18:10

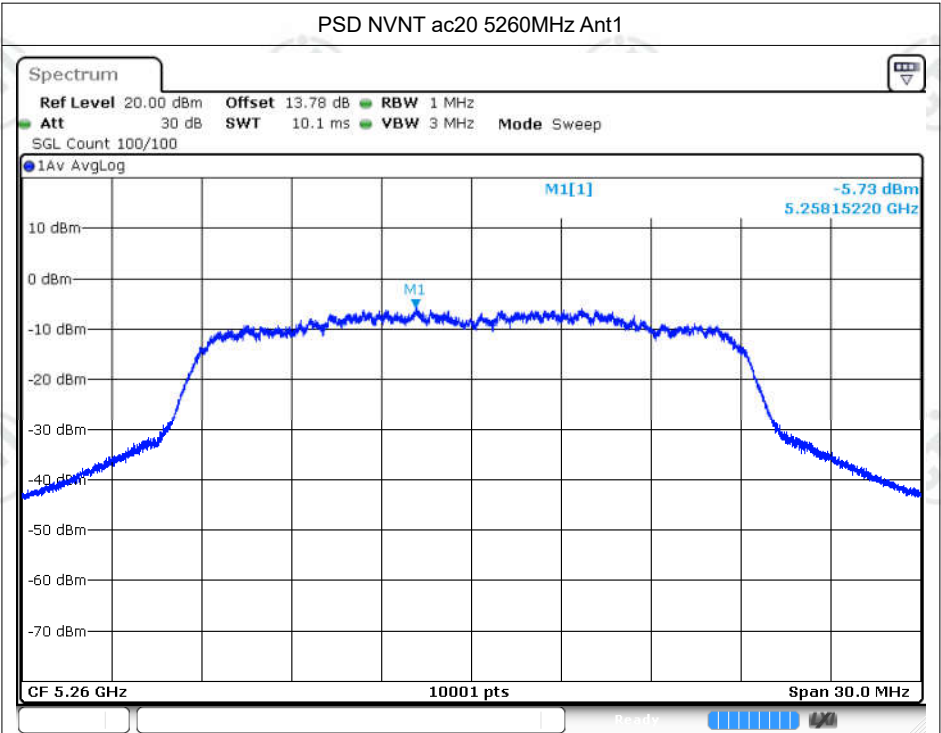


Date: 4.JAN.2025 13:47:33

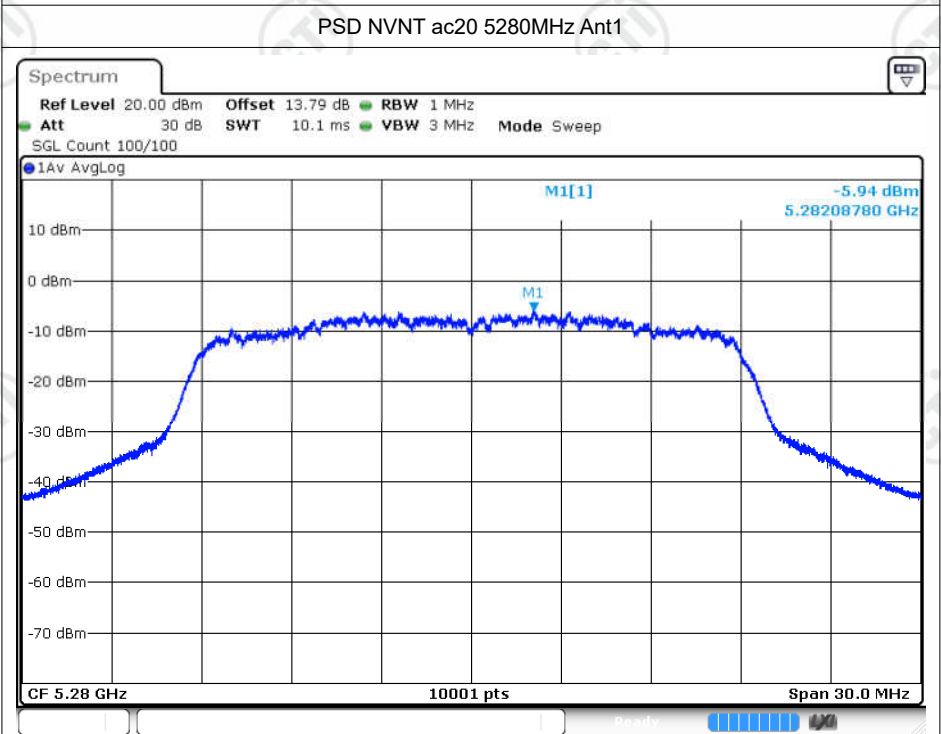


Date: 4.JAN.2025 13:49:15

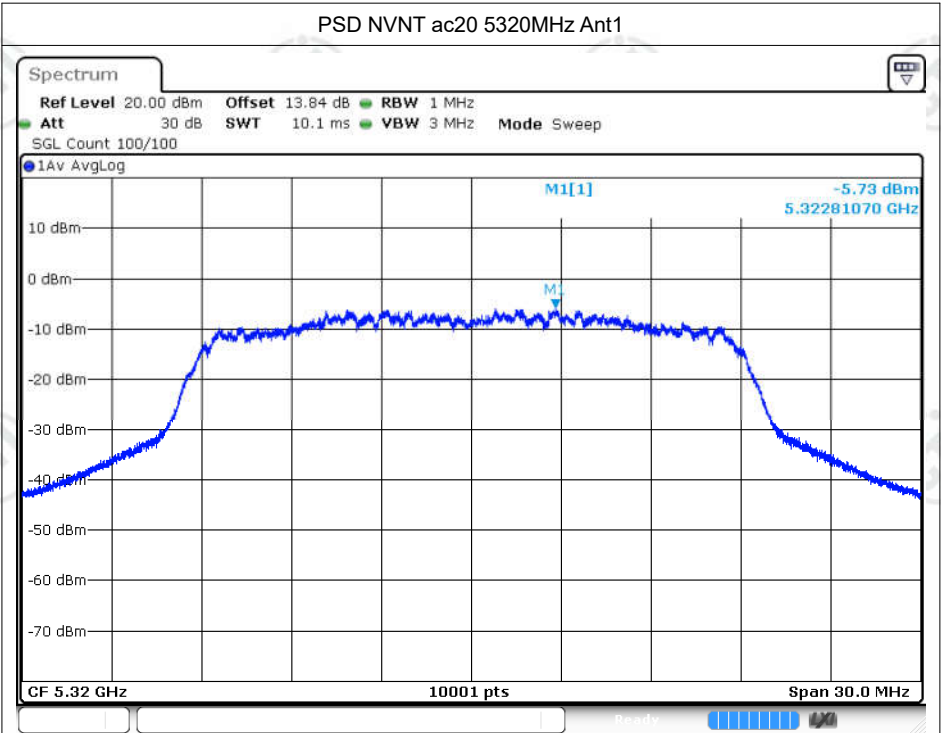


Date: 4.JAN.2025 13:51:10

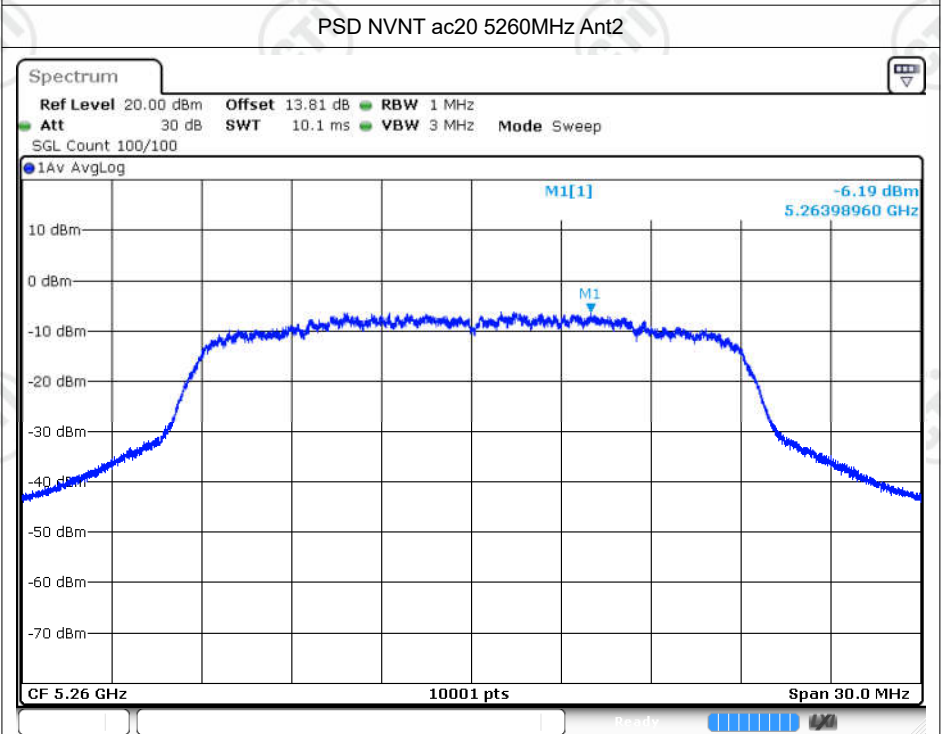


Date: 4.JAN.2025 14:20:03

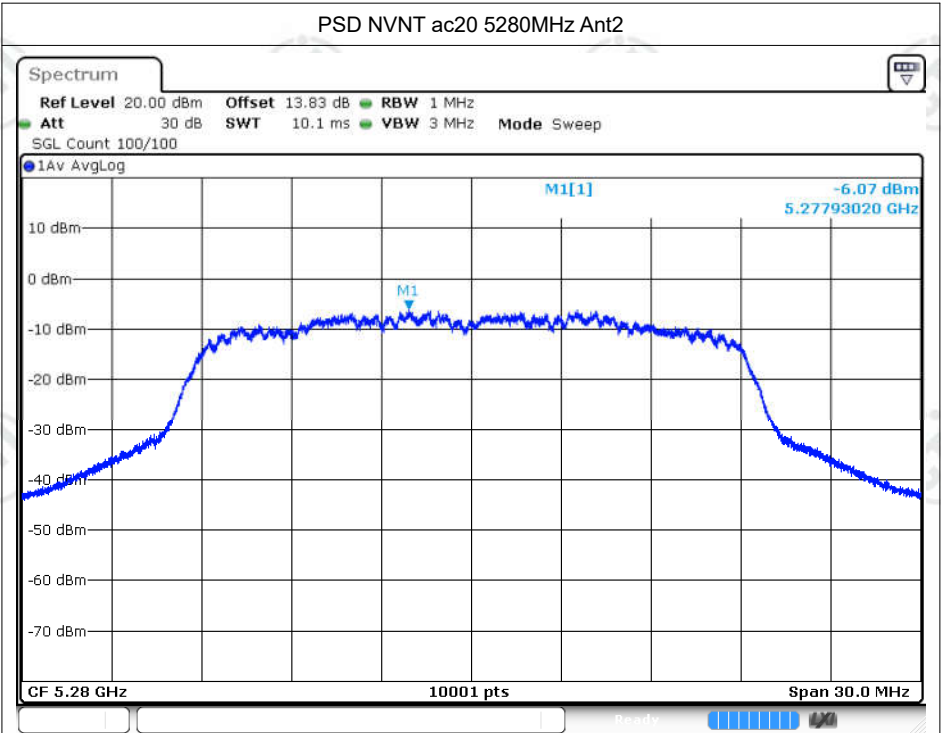


Date: 4.JAN.2025 14:21:21

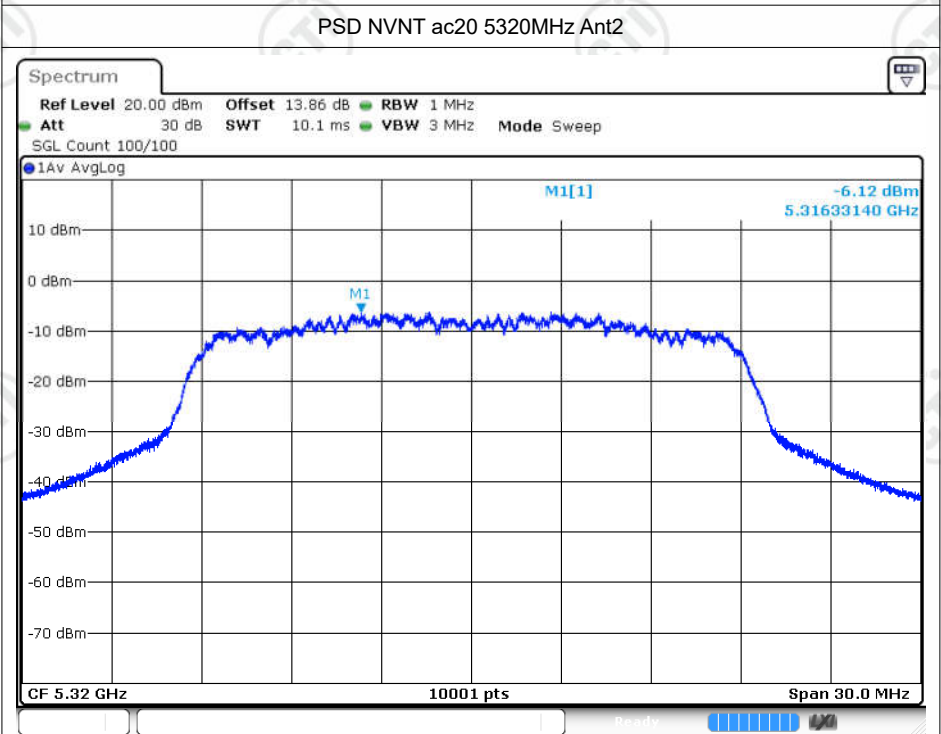


Date: 4.JAN.2025 14:22:46

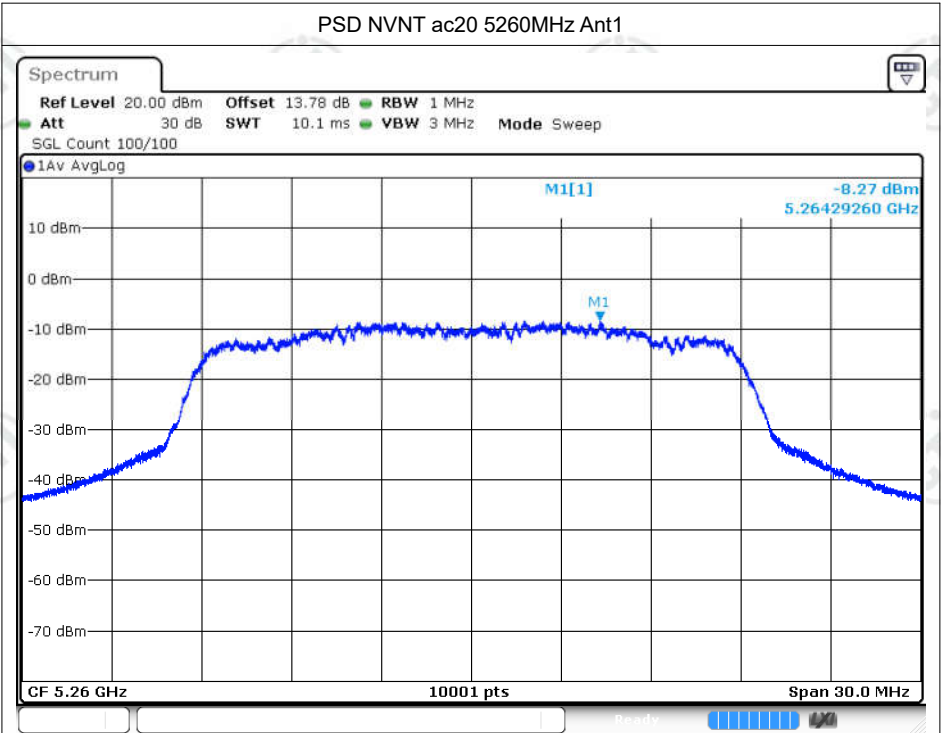


Date: 4.JAN.2025 14:56:11

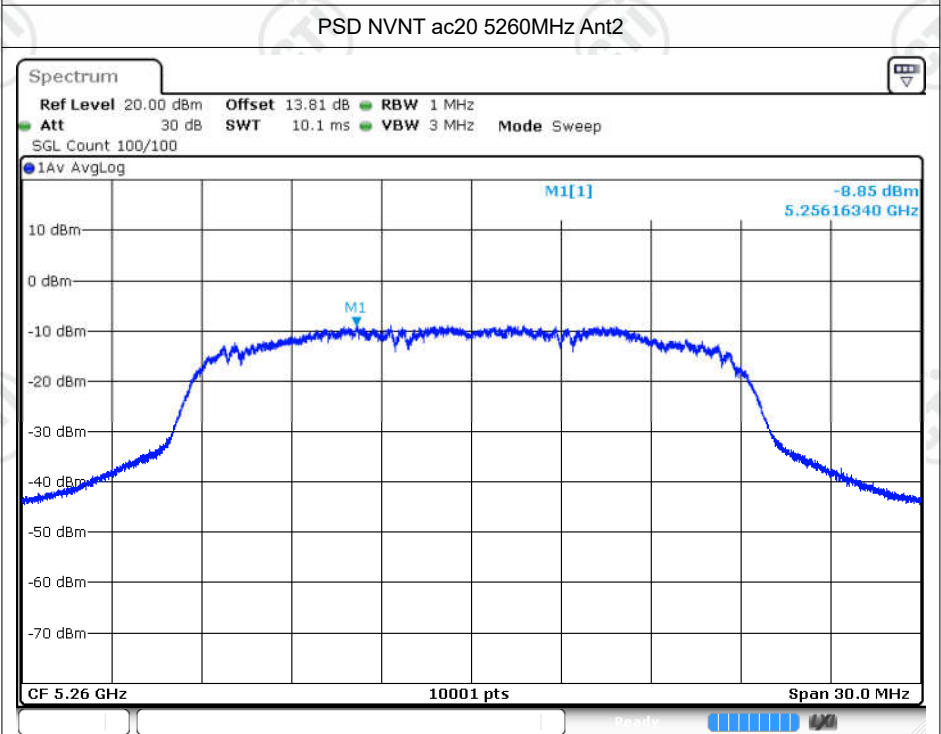


Date: 4.JAN.2025 14:56:14

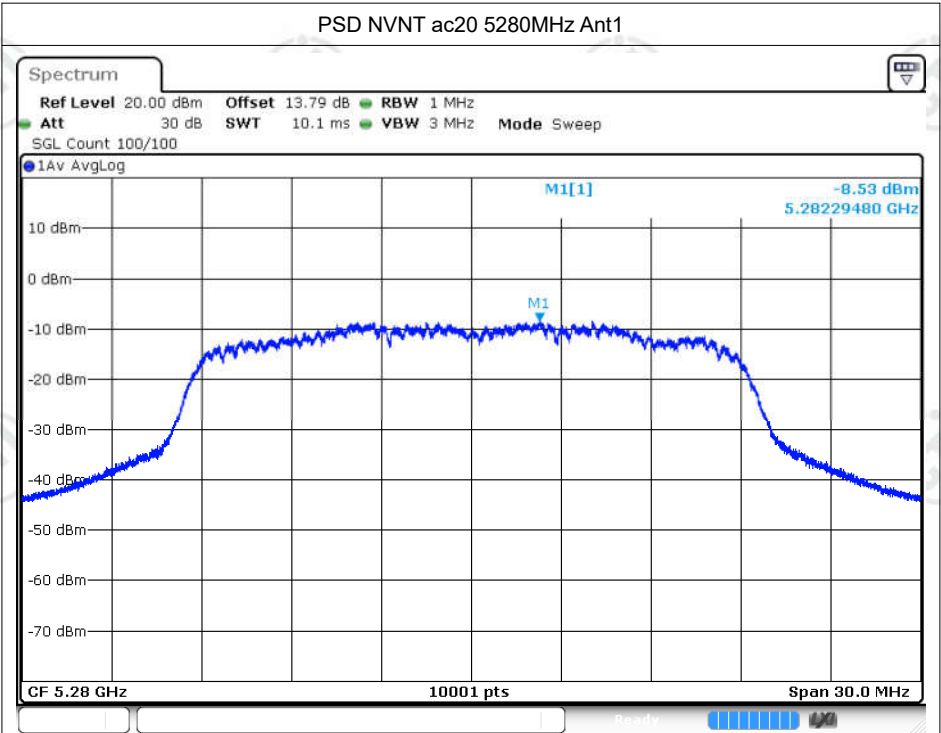


Date: 4.JAN.2025 14:56:41

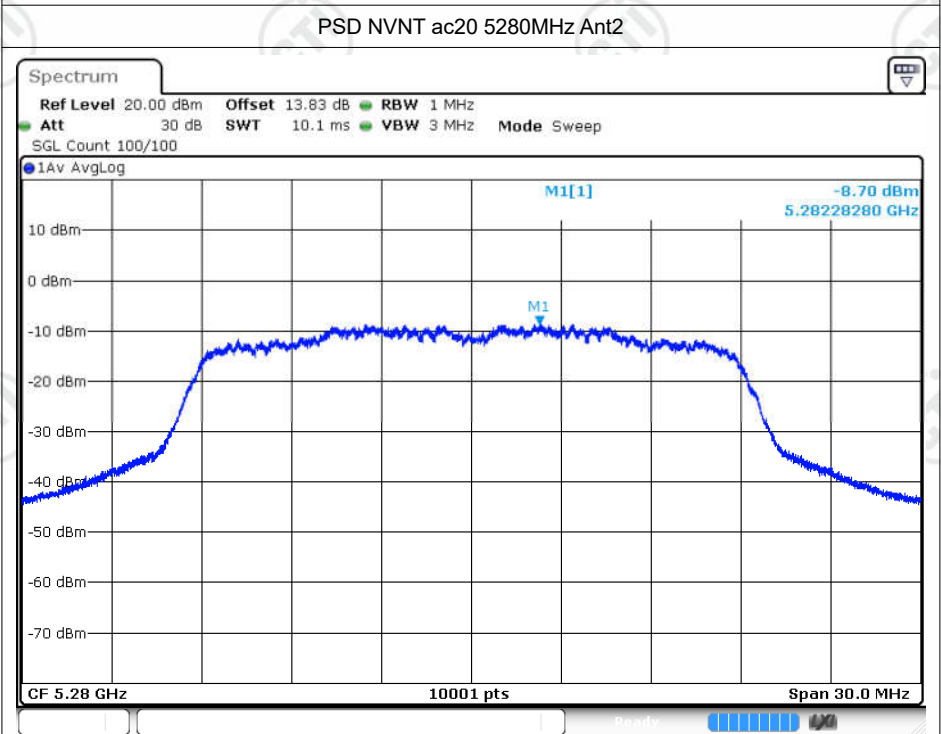


Date: 4.JAN.2025 14:56:45

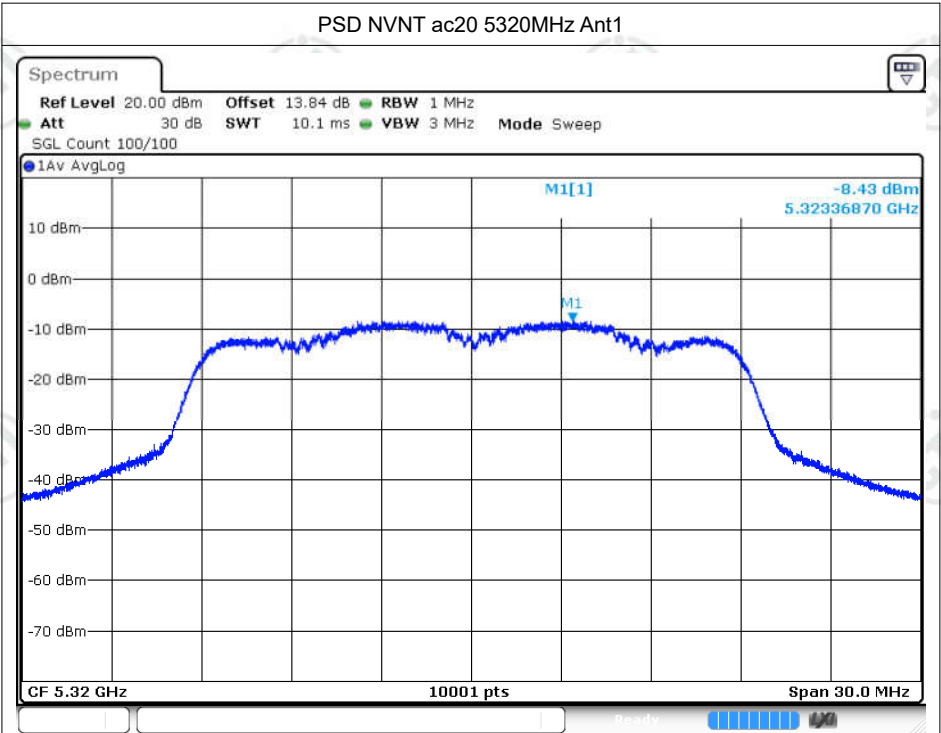


Date: 4.JAN.2025 14:57:18

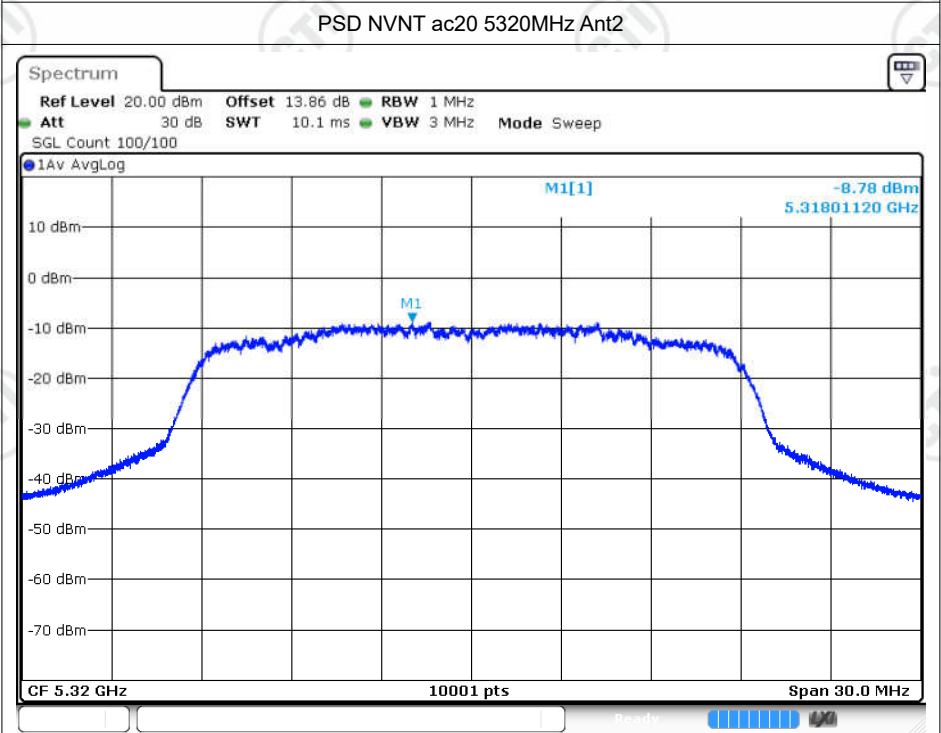


Date: 4.JAN.2025 14:57:21

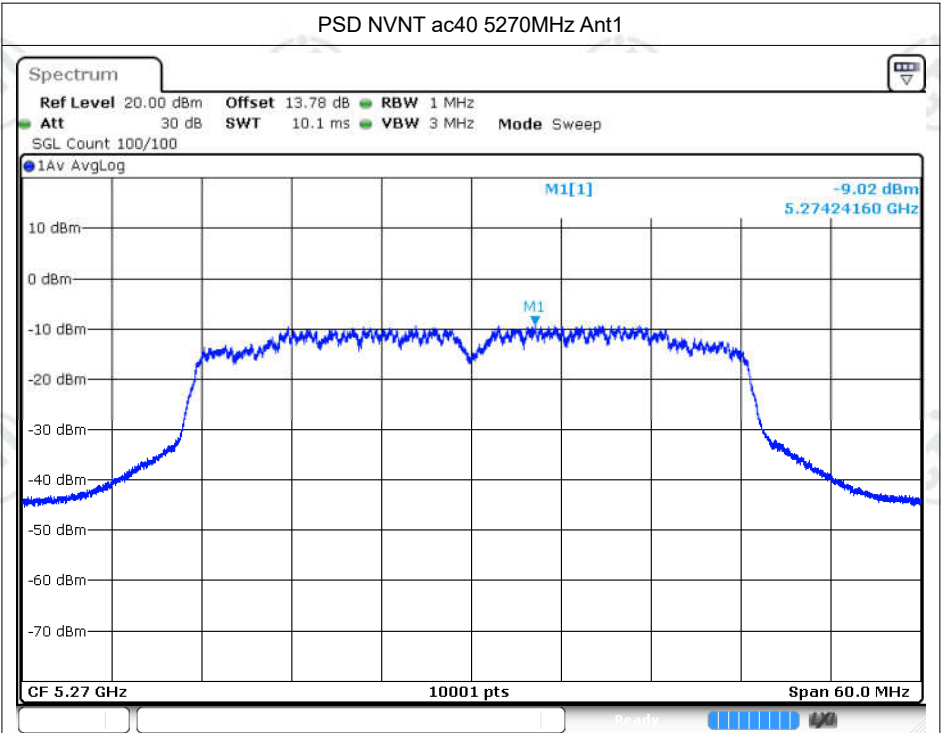


Date: 4.JAN.2025 13:59:21

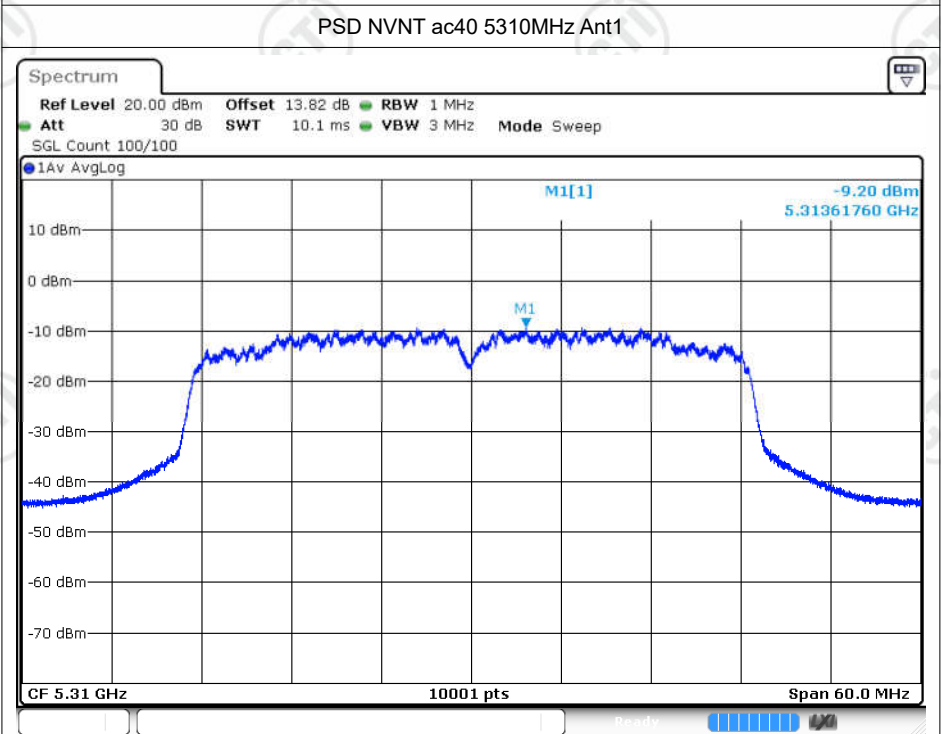


Date: 4.JAN.2025 14:01:39

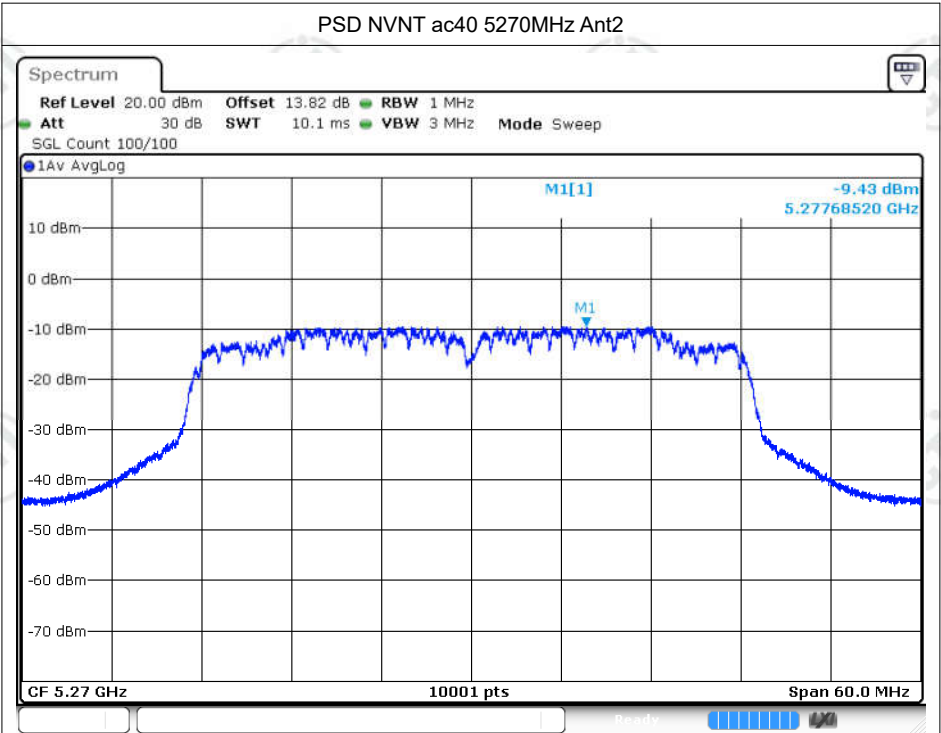


Date: 4.JAN.2025 14:31:34

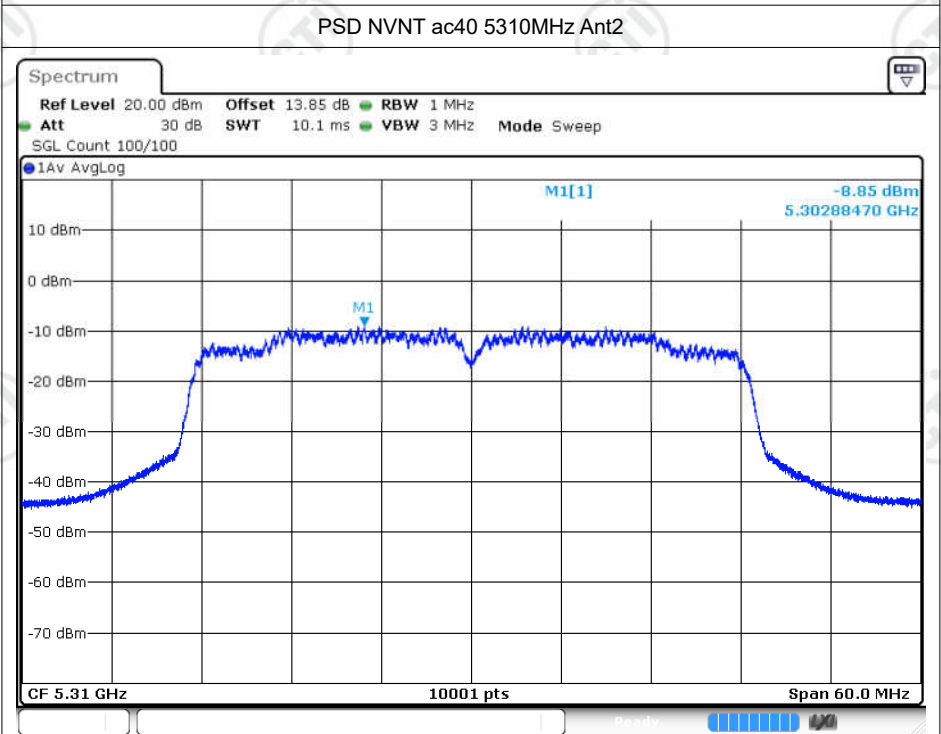


Date: 4.JAN.2025 14:43:58

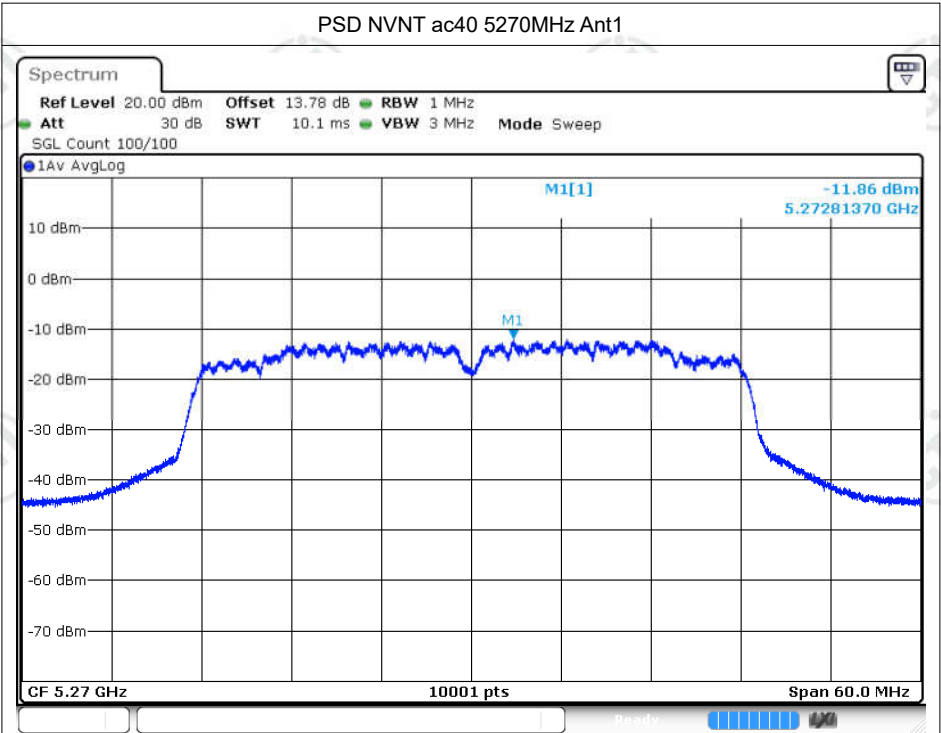


Date: 4.JAN.2025 15:19:48

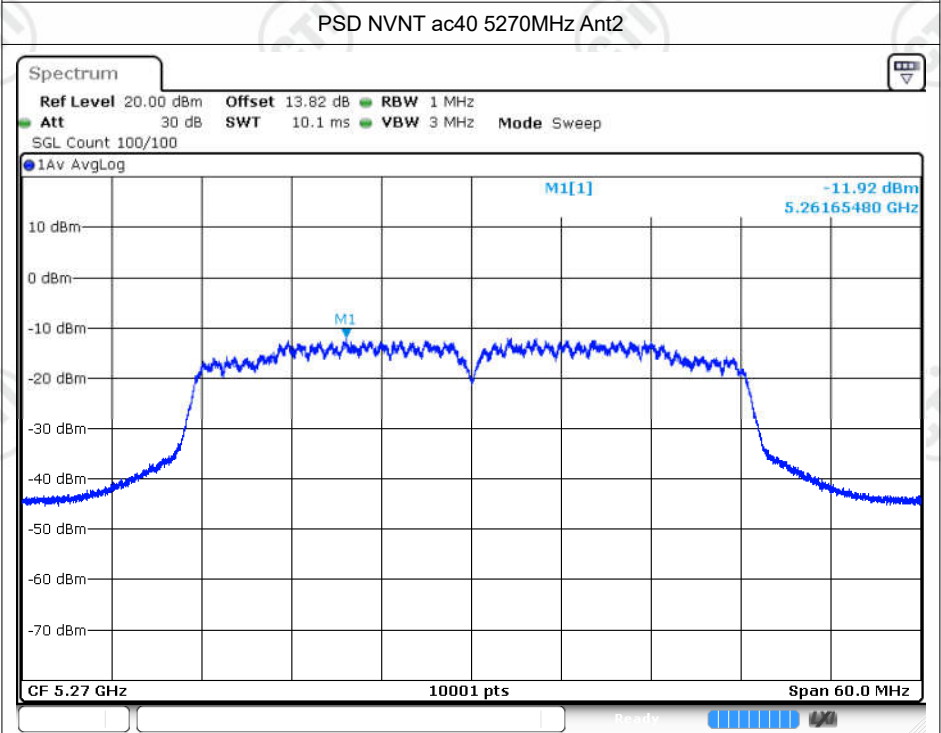


Date: 4.JAN.2025 15:19:51

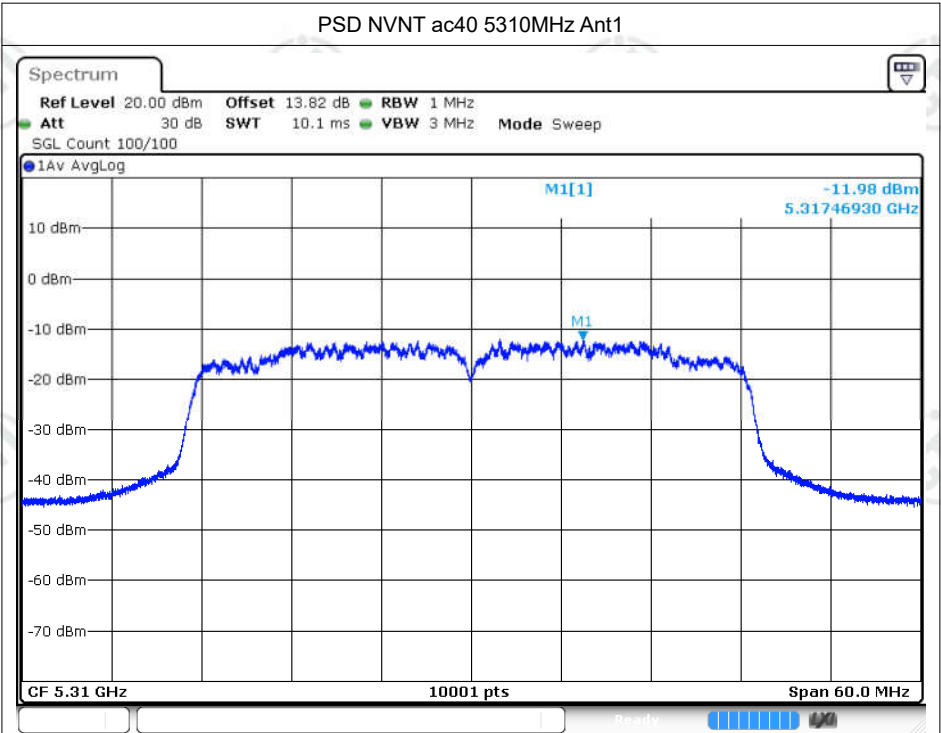


Date: 4.JAN.2025 15:20:28

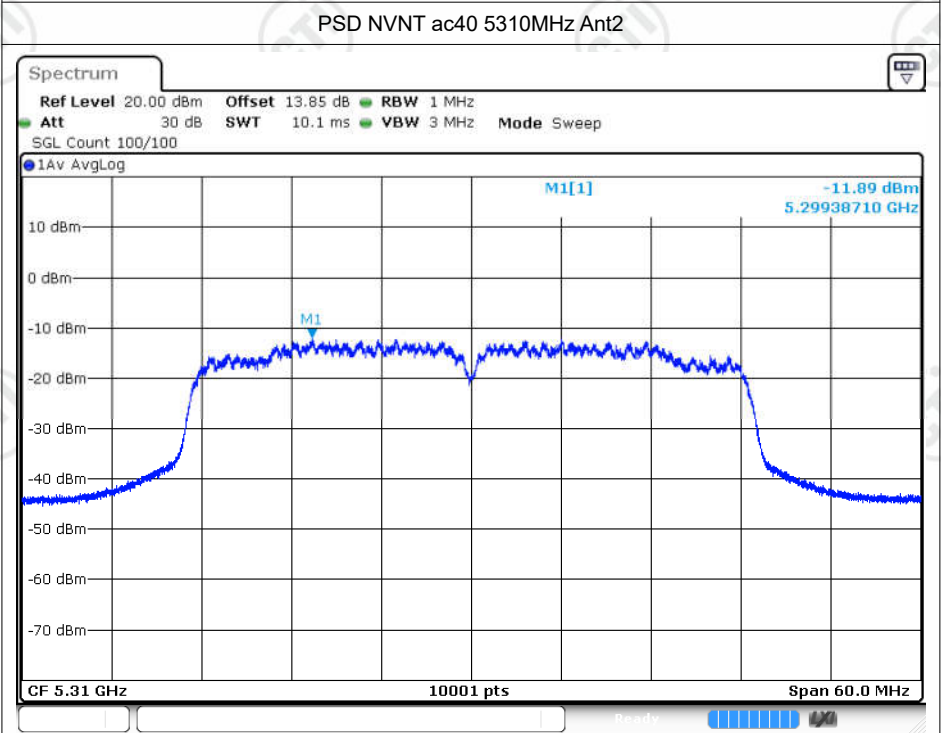


Date: 4.JAN.2025 15:20:31

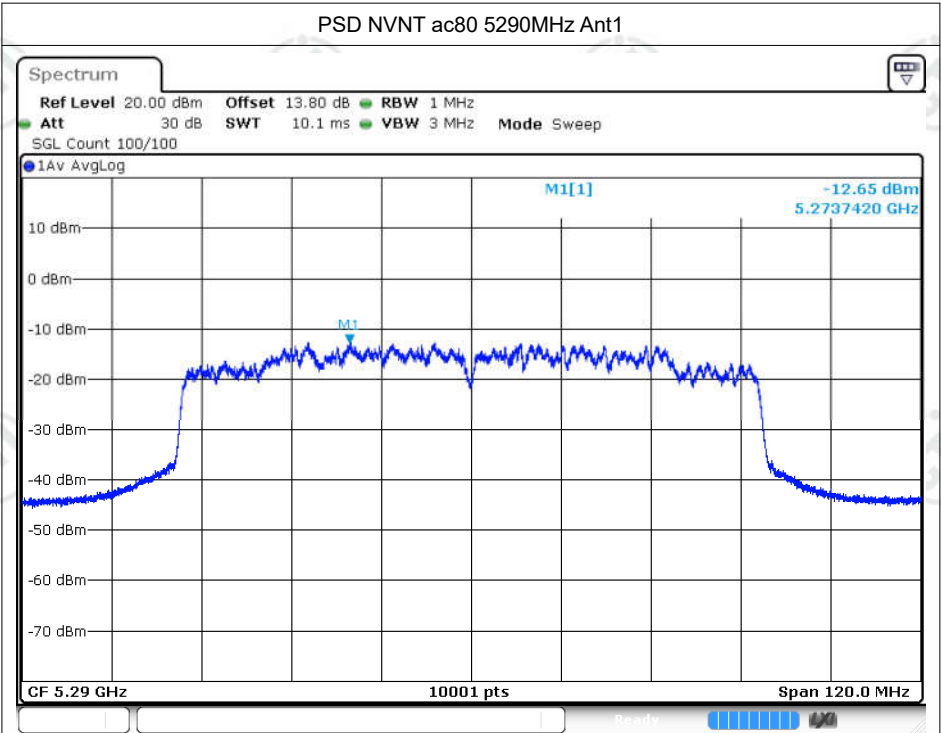


Date: 4. JAN.2025 14:03:38

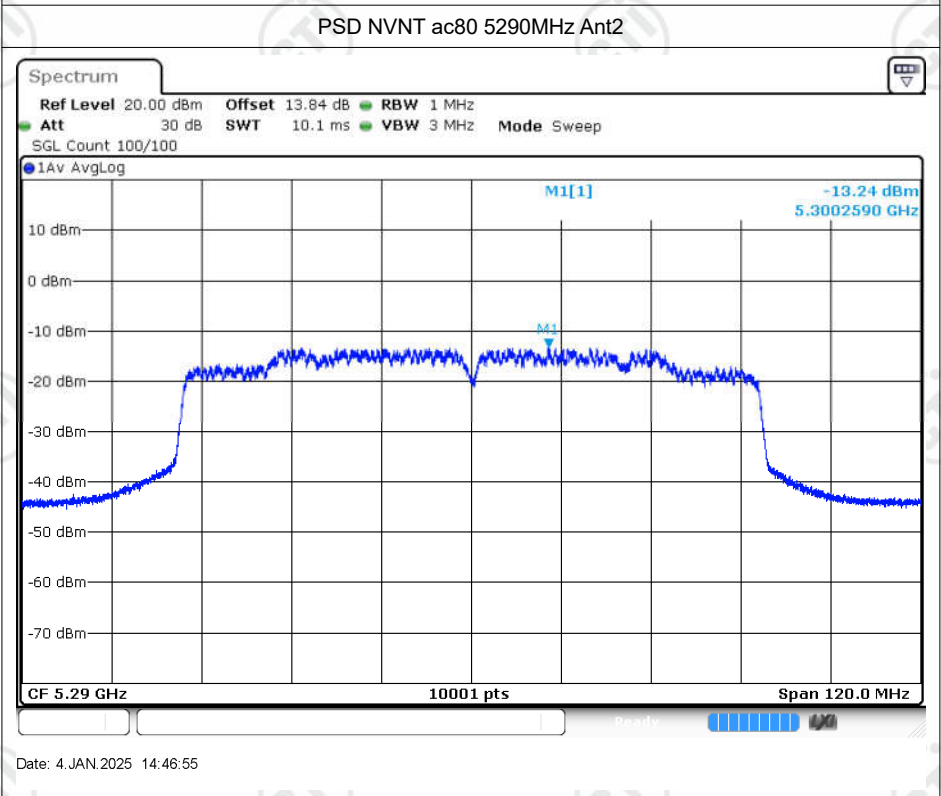

Date: 4. JAN.2025 14:46:55

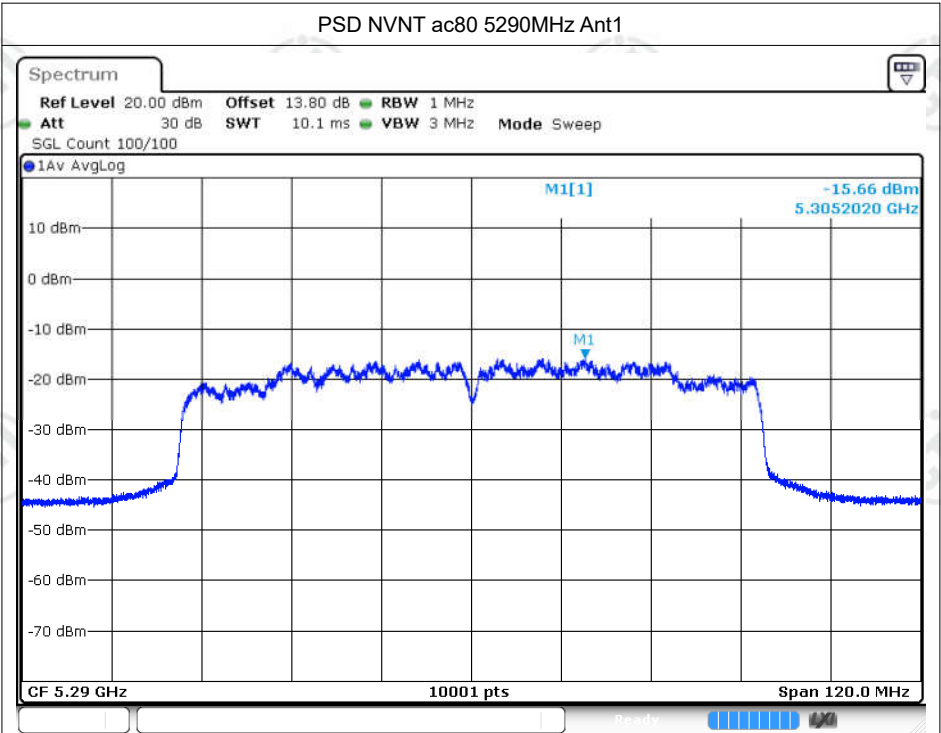

Date: 4.JAN.2025 15:21:09

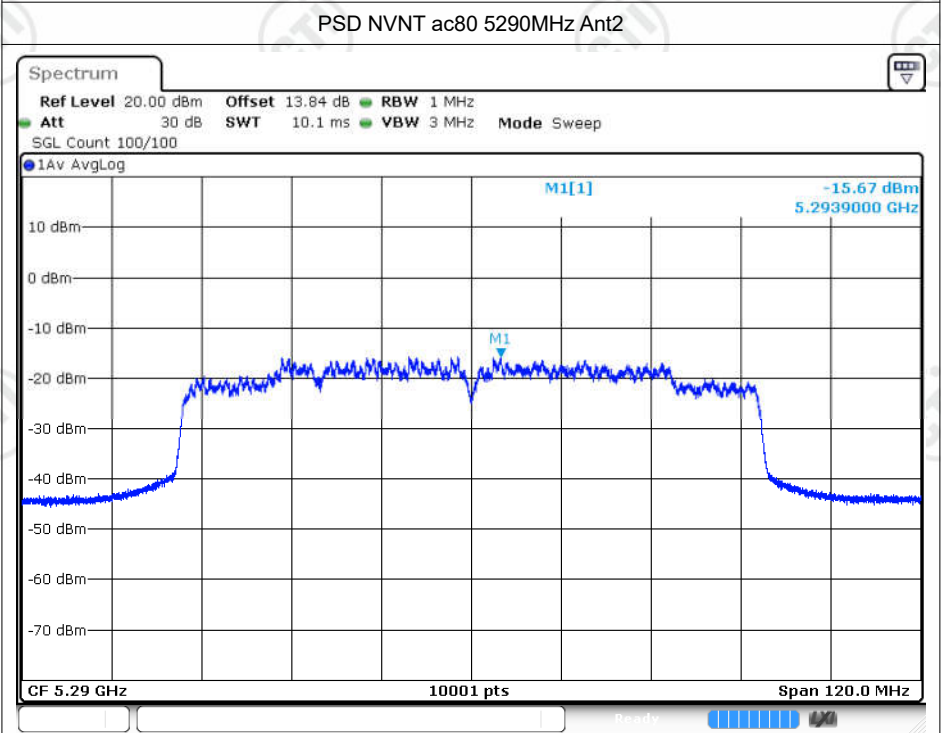

Date: 4.JAN.2025 15:21:12

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 138V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-10C 120V	a	5260	Ant1	5260	0	0	25	Pass
0C 120V	a	5260	Ant1	5260	0	0	25	Pass
10C 120V	a	5260	Ant1	5260	0	0	25	Pass
30C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
40C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
50C 120V	a	5260	Ant1	5260	0	0	25	Pass
20C 102V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 120V	a	5280	Ant1	5280	0	0	25	Pass
20C 138V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-20C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-10C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
0C 120V	a	5280	Ant1	5279.96	-40000	-7.58	25	Pass
10C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
30C 120V	a	5280	Ant1	5279.96	-40000	-7.58	25	Pass
40C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
50C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 102V	a	5320	Ant1	5320	0	0	25	Pass
20C 120V	a	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 138V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-20C 120V	a	5320	Ant1	5320	0	0	25	Pass
-10C 120V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
0C 120V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
10C 120V	a	5320	Ant1	5320	0	0	25	Pass
30C 120V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
40C 120V	a	5320	Ant1	5320	0	0	25	Pass
50C 120V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 102V	a	5260	Ant2	5260	0	0	25	Pass
20C 120V	a	5260	Ant2	5259.98	-20000	-3.8	25	Pass
20C 138V	a	5260	Ant2	5259.98	-20000	-3.8	25	Pass
-20C 120V	a	5260	Ant2	5260.04	40000	7.6	25	Pass
-10C 120V	a	5260	Ant2	5260	0	0	25	Pass
0C 120V	a	5260	Ant2	5259.96	-40000	-7.6	25	Pass
10C 120V	a	5260	Ant2	5260	0	0	25	Pass

30C 120V	a	5260	Ant2	5260	0	0	25	Pass
40C 120V	a	5260	Ant2	5260	0	0	25	Pass
50C 120V	a	5260	Ant2	5260	0	0	25	Pass
20C 102V	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 120V	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 138V	a	5280	Ant2	5279.96	-40000	-7.58	25	Pass
-20C 120V	a	5280	Ant2	5280	0	0	25	Pass
-10C 120V	a	5280	Ant2	5280	0	0	25	Pass
0C 120V	a	5280	Ant2	5279.94	-60000	-11.36	25	Pass
10C 120V	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
30C 120V	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
40C 120V	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
50C 120V	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 102V	a	5320	Ant2	5319.96	-40000	-7.52	25	Pass
20C 120V	a	5320	Ant2	5320	0	0	25	Pass
20C 138V	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
-20C 120V	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
-10C 120V	a	5320	Ant2	5319.96	-40000	-7.52	25	Pass
0C 120V	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
10C 120V	a	5320	Ant2	5320	0	0	25	Pass
30C 120V	a	5320	Ant2	5319.96	-40000	-7.52	25	Pass
40C 120V	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
50C 120V	a	5320	Ant2	5320	0	0	25	Pass
20C 102V	n20	5260	Ant1	5260	0	0	25	Pass
20C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 138V	n20	5260	Ant1	5260	0	0	25	Pass
-20C 120V	n20	5260	Ant1	5260.02	20000	3.8	25	Pass
-10C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 120V	n20	5260	Ant1	5260.02	20000	3.8	25	Pass
10C 120V	n20	5260	Ant1	5260	0	0	25	Pass
30C 120V	n20	5260	Ant1	5260	0	0	25	Pass
40C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
50C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 102V	n20	5280	Ant1	5280	0	0	25	Pass
20C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 138V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-20C 120V	n20	5280	Ant1	5280	0	0	25	Pass
-10C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
0C 120V	n20	5280	Ant1	5280	0	0	25	Pass
10C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
30C 120V	n20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
40C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass


50C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 102V	n20	5320	Ant1	5320	0	0	25	Pass
20C 120V	n20	5320	Ant1	5320	0	0	25	Pass
20C 138V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-20C 120V	n20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
-10C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
0C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
10C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
30C 120V	n20	5320	Ant1	5320	0	0	25	Pass
40C 120V	n20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
50C 120V	n20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 102V	n20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
20C 120V	n20	5260	Ant2	5260	0	0	25	Pass
20C 138V	n20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
-20C 120V	n20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
-10C 120V	n20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
0C 120V	n20	5260	Ant2	5259.96	-40000	-7.6	25	Pass
10C 120V	n20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
30C 120V	n20	5260	Ant2	5260	0	0	25	Pass
40C 120V	n20	5260	Ant2	5259.96	-40000	-7.6	25	Pass
50C 120V	n20	5260	Ant2	5259.96	-40000	-7.6	25	Pass
20C 102V	n20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 120V	n20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 138V	n20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
-20C 120V	n20	5280	Ant2	5280	0	0	25	Pass
-10C 120V	n20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
0C 120V	n20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
10C 120V	n20	5280	Ant2	5280	0	0	25	Pass
30C 120V	n20	5280	Ant2	5280	0	0	25	Pass
40C 120V	n20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
50C 120V	n20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 102V	n20	5320	Ant2	5319.96	-40000	-7.52	25	Pass
20C 120V	n20	5320	Ant2	5319.96	-40000	-7.52	25	Pass
20C 138V	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
-20C 120V	n20	5320	Ant2	5320	0	0	25	Pass
-10C 120V	n20	5320	Ant2	5319.96	-40000	-7.52	25	Pass
0C 120V	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
10C 120V	n20	5320	Ant2	5320.02	20000	3.76	25	Pass
30C 120V	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
40C 120V	n20	5320	Ant2	5319.96	-40000	-7.52	25	Pass
50C 120V	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
20C 102V	n40	5270	Ant1	5270	0	0	25	Pass

20C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
20C 138V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
-20C 120V	n40	5270	Ant1	5270	0	0	25	Pass
-10C 120V	n40	5270	Ant1	5270	0	0	25	Pass
0C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
10C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
30C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
40C 120V	n40	5270	Ant1	5270	0	0	25	Pass
50C 120V	n40	5270	Ant1	5270	0	0	25	Pass
20C 102V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
20C 120V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
20C 138V	n40	5310	Ant1	5310	0	0	25	Pass
-20C 120V	n40	5310	Ant1	5310	0	0	25	Pass
-10C 120V	n40	5310	Ant1	5310	0	0	25	Pass
0C 120V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
10C 120V	n40	5310	Ant1	5310	0	0	25	Pass
30C 120V	n40	5310	Ant1	5310	0	0	25	Pass
40C 120V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
50C 120V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
20C 102V	n40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
20C 120V	n40	5270	Ant2	5270	0	0	25	Pass
20C 138V	n40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
-20C 120V	n40	5270	Ant2	5270	0	0	25	Pass
-10C 120V	n40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
0C 120V	n40	5270	Ant2	5270	0	0	25	Pass
10C 120V	n40	5270	Ant2	5270	0	0	25	Pass
30C 120V	n40	5270	Ant2	5269.92	-80000	-15.18	25	Pass
40C 120V	n40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
50C 120V	n40	5270	Ant2	5270	0	0	25	Pass
20C 102V	n40	5310	Ant2	5310	0	0	25	Pass
20C 120V	n40	5310	Ant2	5310	0	0	25	Pass
20C 138V	n40	5310	Ant2	5310.04	40000	7.53	25	Pass
-20C 120V	n40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
-10C 120V	n40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
0C 120V	n40	5310	Ant2	5310	0	0	25	Pass
10C 120V	n40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
30C 120V	n40	5310	Ant2	5310	0	0	25	Pass
40C 120V	n40	5310	Ant2	5310	0	0	25	Pass
50C 120V	n40	5310	Ant2	5310	0	0	25	Pass
20C 102V	ac20	5260	Ant1	5260	0	0	25	Pass
20C 120V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 138V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass


-20C 120V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-10C 120V	ac20	5260	Ant1	5260	0	0	25	Pass
0C 120V	ac20	5260	Ant1	5260	0	0	25	Pass
10C 120V	ac20	5260	Ant1	5260.02	20000	3.8	25	Pass
30C 120V	ac20	5260	Ant1	5260	0	0	25	Pass
40C 120V	ac20	5260	Ant1	5260	0	0	25	Pass
50C 120V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 102V	ac20	5280	Ant1	5280	0	0	25	Pass
20C 120V	ac20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
20C 138V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-20C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-10C 120V	ac20	5280	Ant1	5280	0	0	25	Pass
0C 120V	ac20	5280	Ant1	5280	0	0	25	Pass
10C 120V	ac20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
30C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
50C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 102V	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 120V	ac20	5320	Ant1	5320	0	0	25	Pass
20C 138V	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-20C 120V	ac20	5320	Ant1	5320	0	0	25	Pass
-10C 120V	ac20	5320	Ant1	5320	0	0	25	Pass
0C 120V	ac20	5320	Ant1	5320	0	0	25	Pass
10C 120V	ac20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
30C 120V	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
40C 120V	ac20	5320	Ant1	5320	0	0	25	Pass
50C 120V	ac20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 102V	ac20	5260	Ant2	5260	0	0	25	Pass
20C 120V	ac20	5260	Ant2	5260	0	0	25	Pass
20C 138V	ac20	5260	Ant2	5259.94	-60000	-11.41	25	Pass
-20C 120V	ac20	5260	Ant2	5260	0	0	25	Pass
-10C 120V	ac20	5260	Ant2	5260.02	20000	3.8	25	Pass
0C 120V	ac20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
10C 120V	ac20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
30C 120V	ac20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
40C 120V	ac20	5260	Ant2	5259.96	-40000	-7.6	25	Pass
50C 120V	ac20	5260	Ant2	5260	0	0	25	Pass
20C 102V	ac20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 120V	ac20	5280	Ant2	5279.96	-40000	-7.58	25	Pass
20C 138V	ac20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
-20C 120V	ac20	5280	Ant2	5279.96	-40000	-7.58	25	Pass
-10C 120V	ac20	5280	Ant2	5280	0	0	25	Pass

0C 120V	ac20	5280	Ant2	5280	0	0	25	Pass
10C 120V	ac20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
30C 120V	ac20	5280	Ant2	5279.96	-40000	-7.58	25	Pass
40C 120V	ac20	5280	Ant2	5280	0	0	25	Pass
50C 120V	ac20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 102V	ac20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
20C 120V	ac20	5320	Ant2	5319.96	-40000	-7.52	25	Pass
20C 138V	ac20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
-20C 120V	ac20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
-10C 120V	ac20	5320	Ant2	5319.96	-40000	-7.52	25	Pass
0C 120V	ac20	5320	Ant2	5320	0	0	25	Pass
10C 120V	ac20	5320	Ant2	5320	0	0	25	Pass
30C 120V	ac20	5320	Ant2	5319.96	-40000	-7.52	25	Pass
40C 120V	ac20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
50C 120V	ac20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
20C 102V	ac40	5270	Ant1	5270	0	0	25	Pass
20C 120V	ac40	5270	Ant1	5270	0	0	25	Pass
20C 138V	ac40	5270	Ant1	5270	0	0	25	Pass
-20C 120V	ac40	5270	Ant1	5270	0	0	25	Pass
-10C 120V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
0C 120V	ac40	5270	Ant1	5270	0	0	25	Pass
10C 120V	ac40	5270	Ant1	5270	0	0	25	Pass
30C 120V	ac40	5270	Ant1	5270.04	40000	7.59	25	Pass
40C 120V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
50C 120V	ac40	5270	Ant1	5270	0	0	25	Pass
20C 102V	ac40	5310	Ant1	5310	0	0	25	Pass
20C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
20C 138V	ac40	5310	Ant1	5310	0	0	25	Pass
-20C 120V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
-10C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
0C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
10C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
30C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
40C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
50C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
20C 102V	ac40	5270	Ant2	5270	0	0	25	Pass
20C 120V	ac40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
20C 138V	ac40	5270	Ant2	5270.04	40000	7.59	25	Pass
-20C 120V	ac40	5270	Ant2	5270.04	40000	7.59	25	Pass
-10C 120V	ac40	5270	Ant2	5270	0	0	25	Pass
0C 120V	ac40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
10C 120V	ac40	5270	Ant2	5269.96	-40000	-7.59	25	Pass


30C 120V	ac40	5270	Ant2	5270	0	0	25	Pass
40C 120V	ac40	5270	Ant2	5270	0	0	25	Pass
50C 120V	ac40	5270	Ant2	5270	0	0	25	Pass
20C 102V	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
20C 120V	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
20C 138V	ac40	5310	Ant2	5310	0	0	25	Pass
-20C 120V	ac40	5310	Ant2	5310	0	0	25	Pass
-10C 120V	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
0C 120V	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
10C 120V	ac40	5310	Ant2	5310	0	0	25	Pass
30C 120V	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
40C 120V	ac40	5310	Ant2	5310	0	0	25	Pass
50C 120V	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
20C 102V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 138V	ac80	5290	Ant1	5289.92	-80000	-15.12	25	Pass
-20C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
-10C 120V	ac80	5290	Ant1	5289.92	-80000	-15.12	25	Pass
0C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
10C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
30C 120V	ac80	5290	Ant1	5289.92	-80000	-15.12	25	Pass
40C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
50C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 102V	ac80	5290	Ant2	5289.84	-160000	-30.25	25	Pass
20C 120V	ac80	5290	Ant2	5290	0	0	25	Pass
20C 138V	ac80	5290	Ant2	5290	0	0	25	Pass
-20C 120V	ac80	5290	Ant2	5290	0	0	25	Pass
-10C 120V	ac80	5290	Ant2	5290	0	0	25	Pass
0C 120V	ac80	5290	Ant2	5290	0	0	25	Pass
10C 120V	ac80	5290	Ant2	5290	0	0	25	Pass
30C 120V	ac80	5290	Ant2	5290	0	0	25	Pass
40C 120V	ac80	5290	Ant2	5290	0	0	25	Pass
50C 120V	ac80	5290	Ant2	5290	0	0	25	Pass

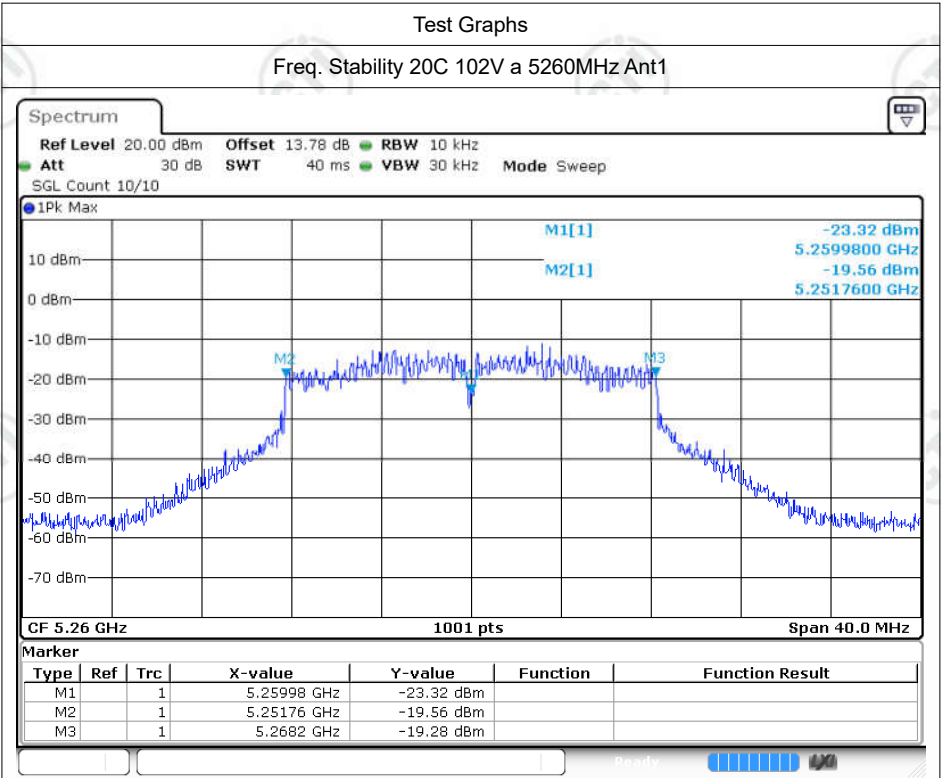


Date: 4. JAN.2025 13:38:14

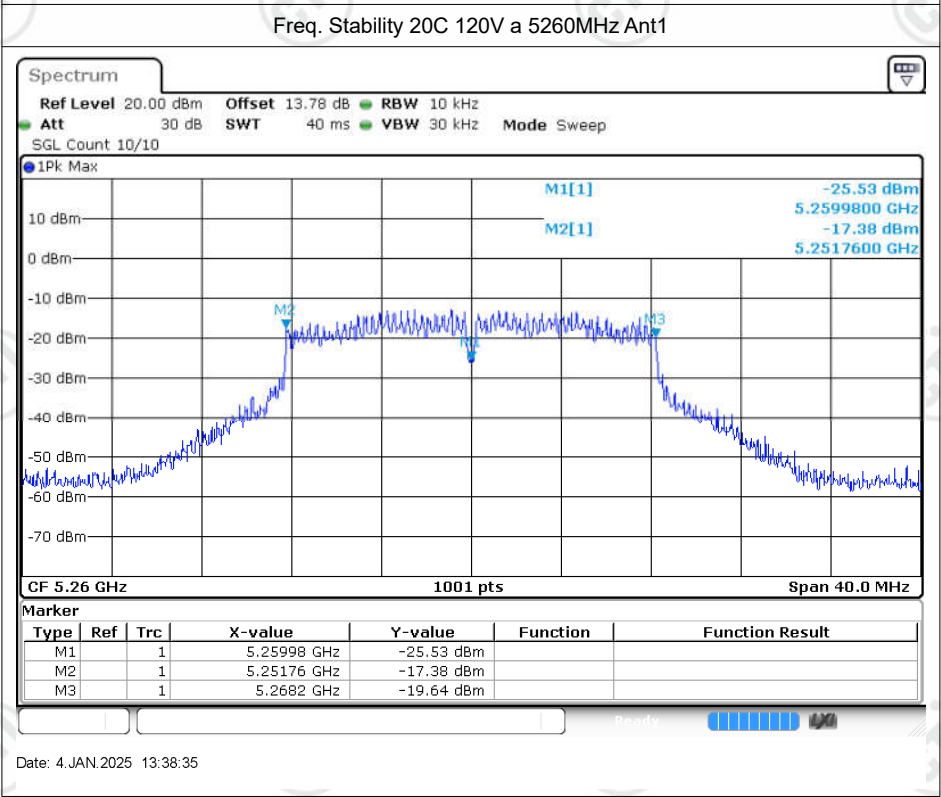


Date: 4. JAN.2025 13:38:35

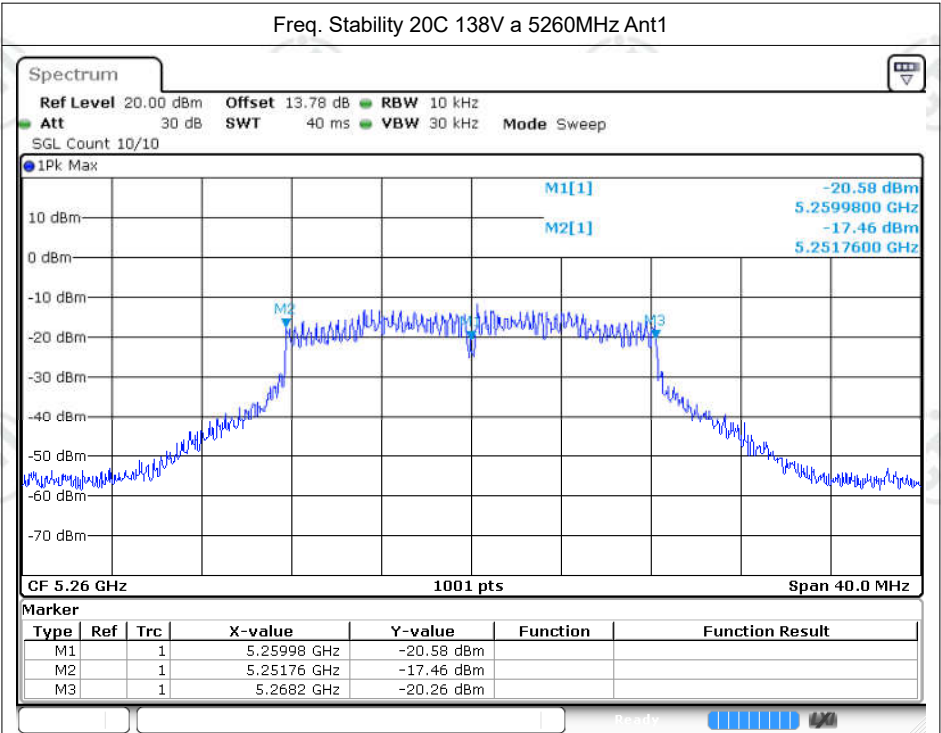


Date: 4.JAN.2025 13:38:20

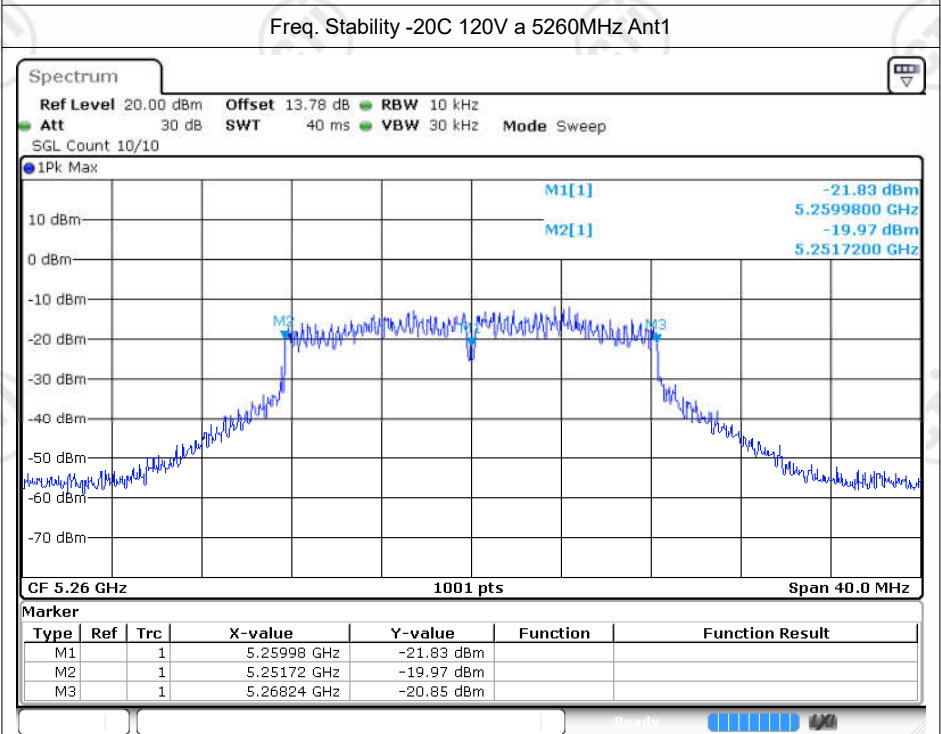


Date: 4.JAN.2025 13:38:23

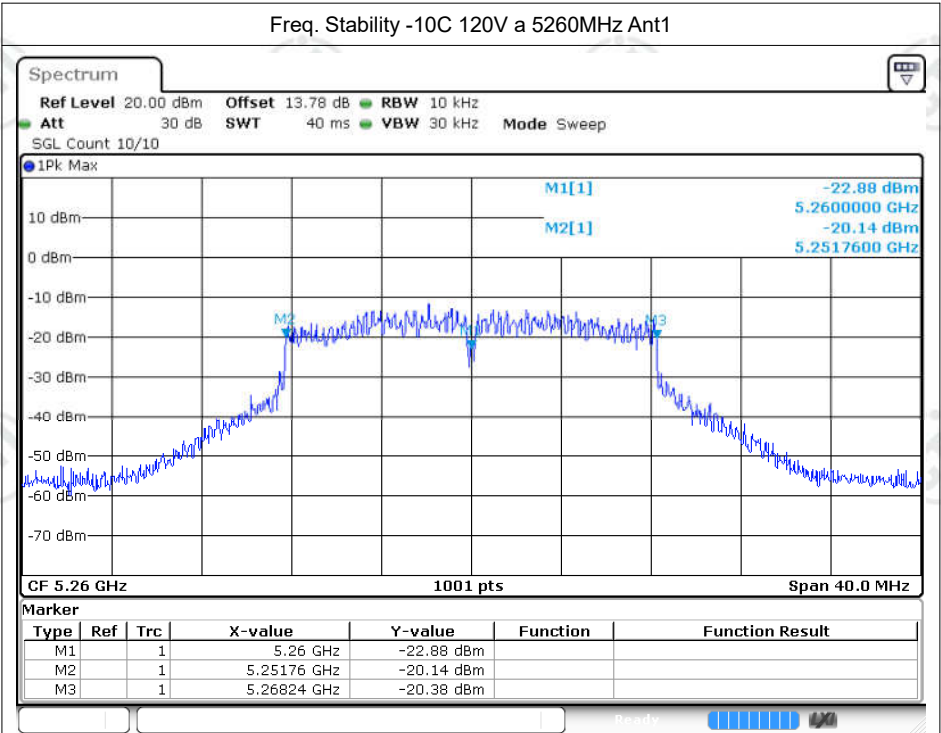


Date: 4.JAN.2025 13:38:26

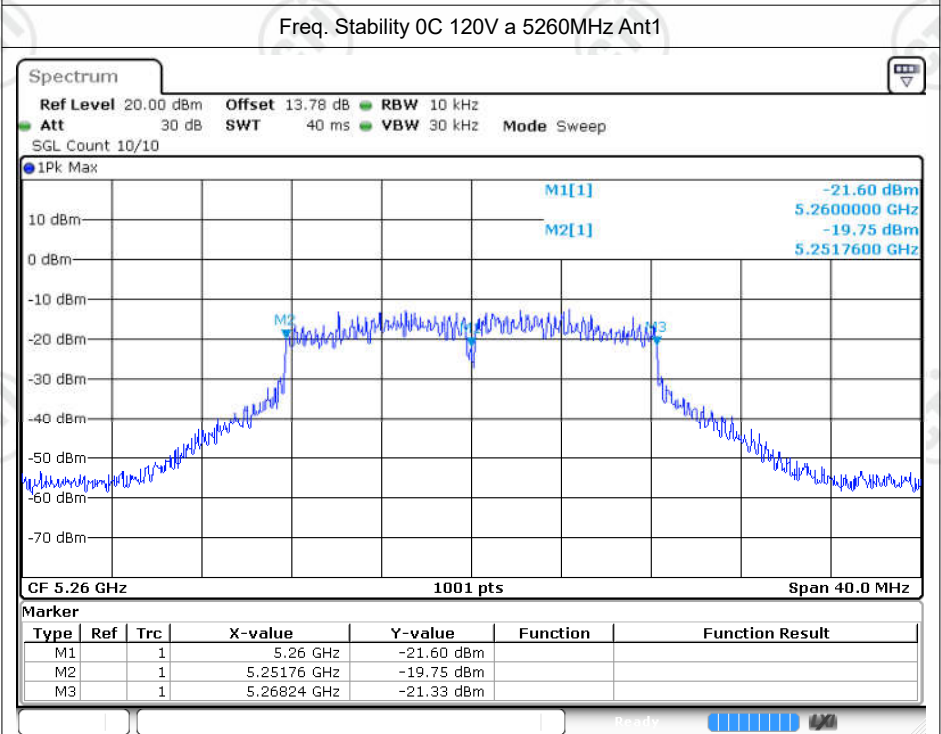


Date: 4.JAN.2025 13:38:29

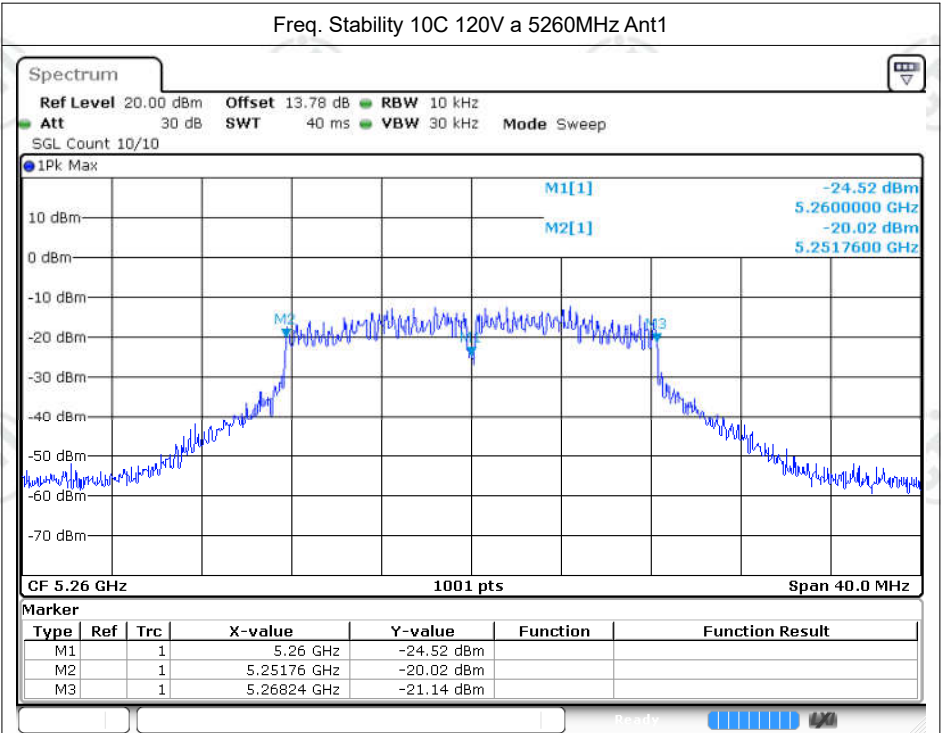


Date: 4.JAN.2025 13:38:32

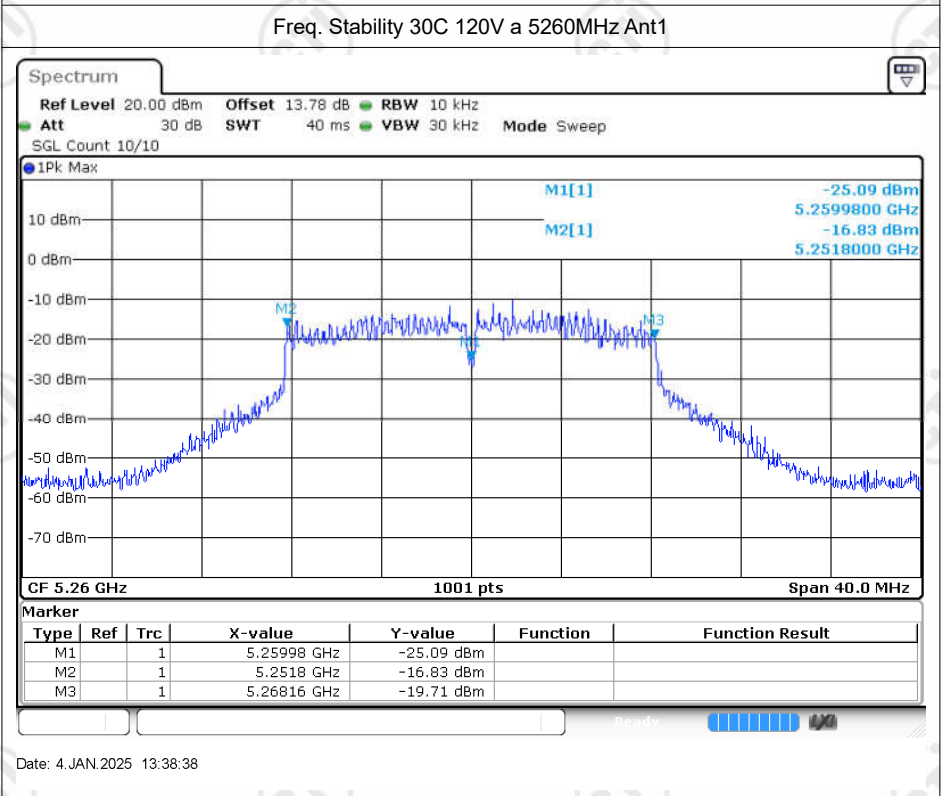


Date: 4.JAN.2025 13:38:38

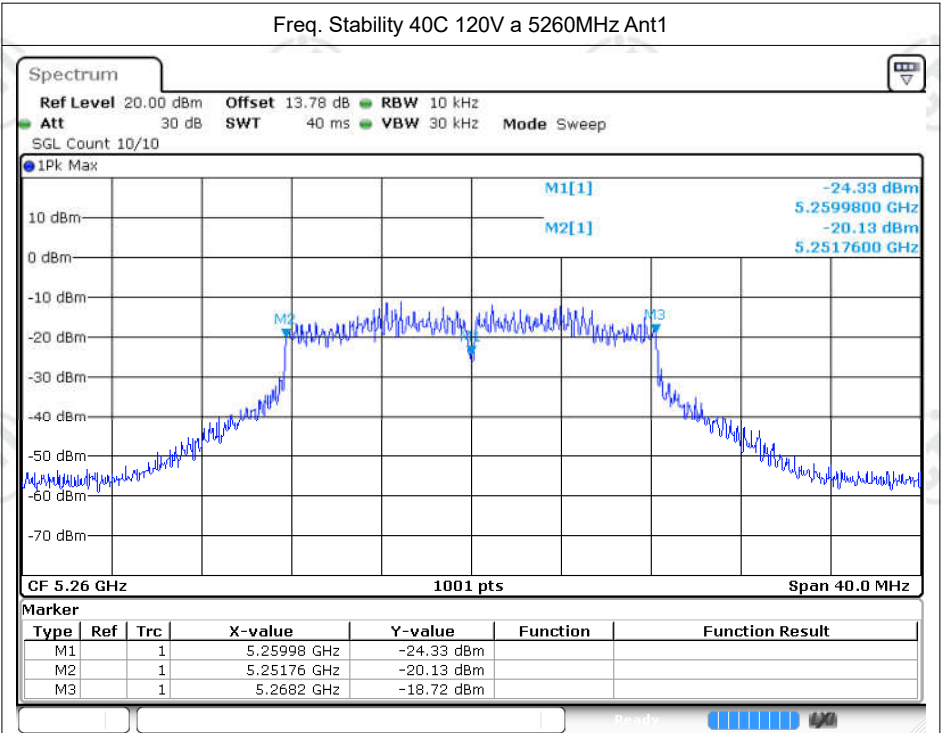


Date: 4.JAN.2025 13:38:41

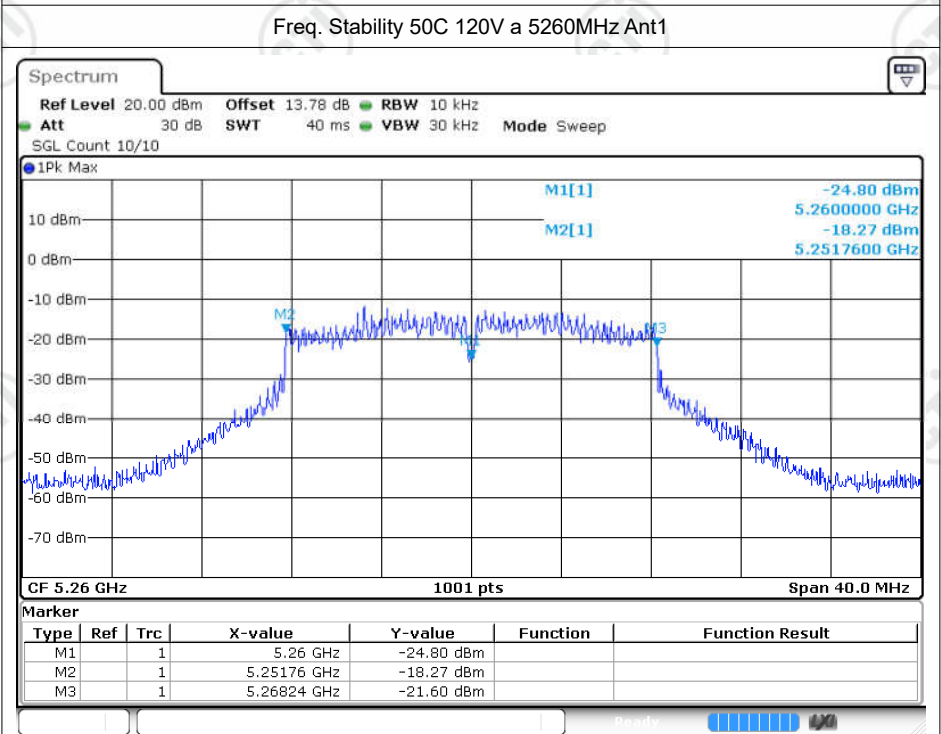


Date: 4.JAN.2025 13:38:44

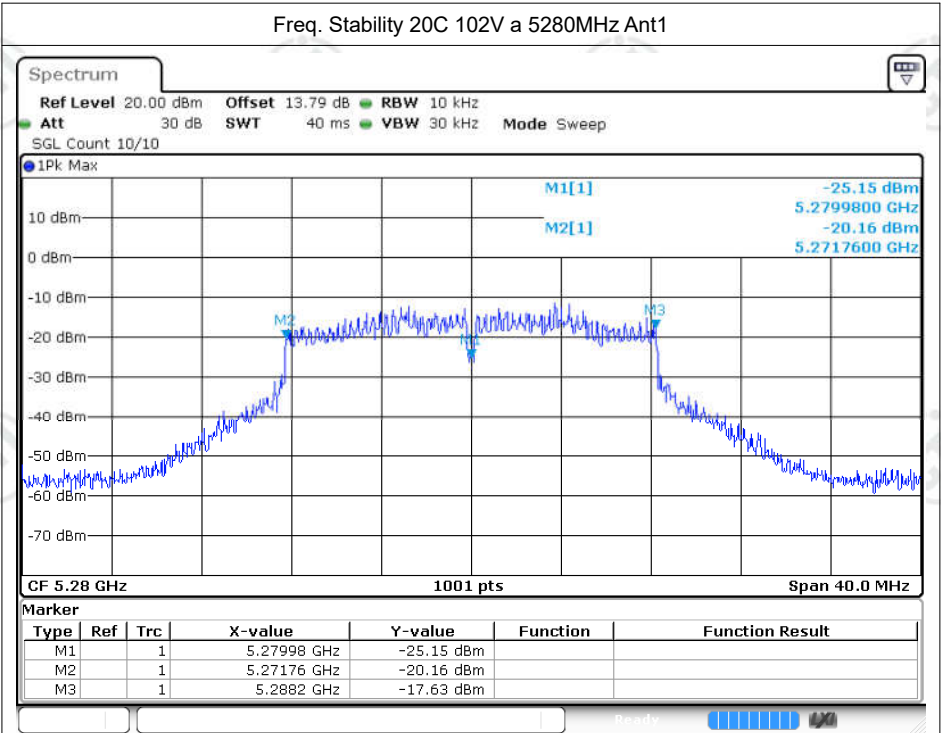


Date: 4.JAN.2025 13:39:42

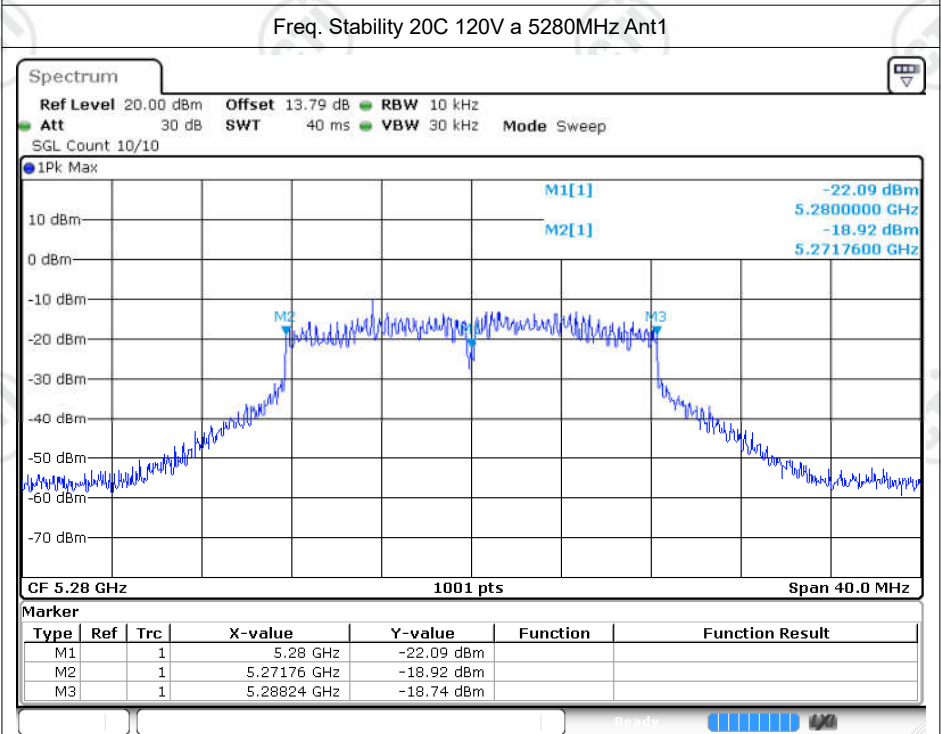


Date: 4.JAN.2025 13:40:03

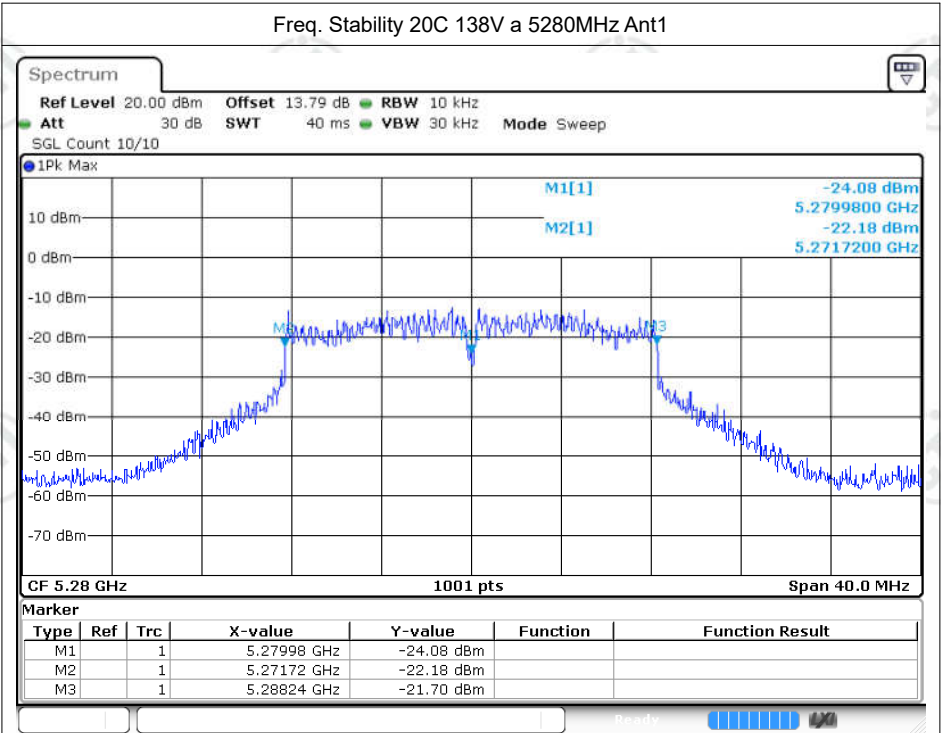


Date: 4.JAN.2025 13:39:48

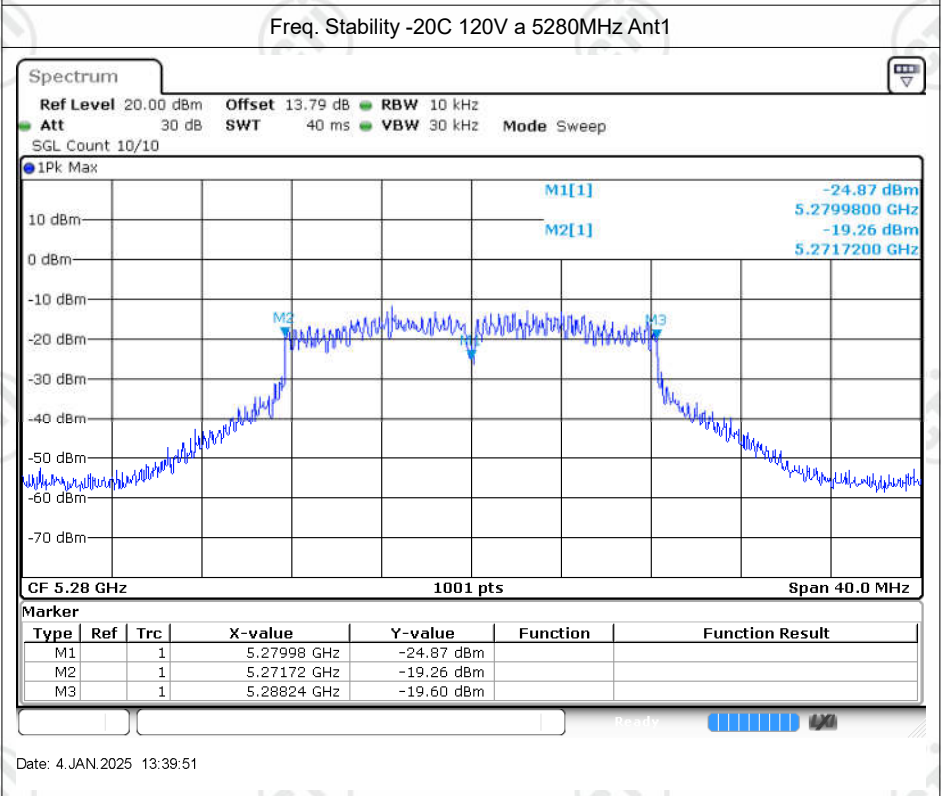


Date: 4.JAN.2025 13:39:51

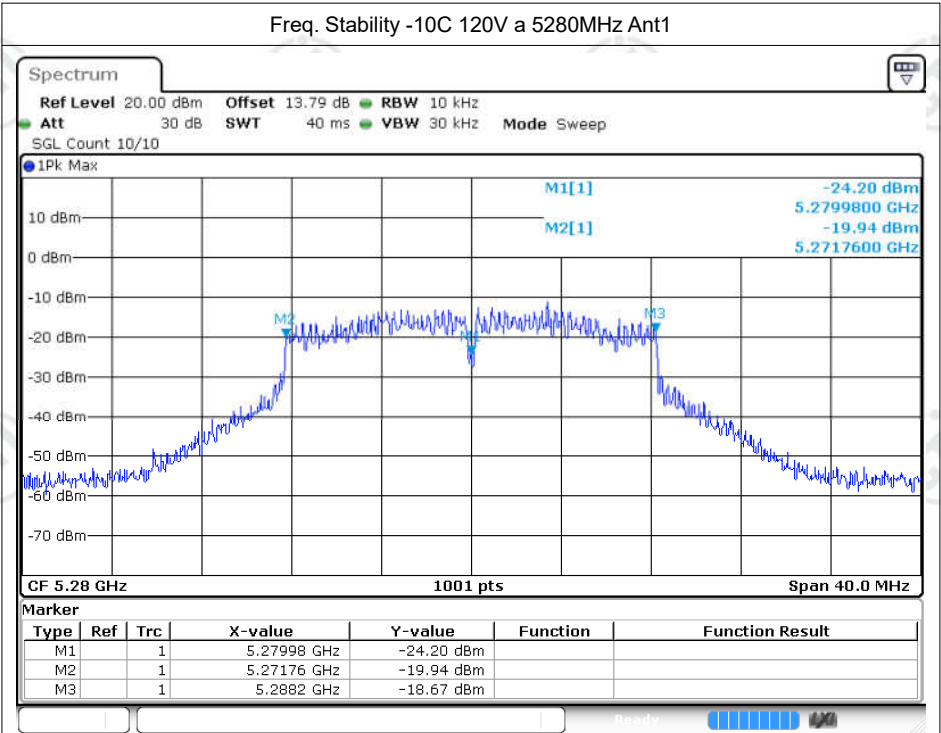


Date: 4.JAN.2025 13:39:54

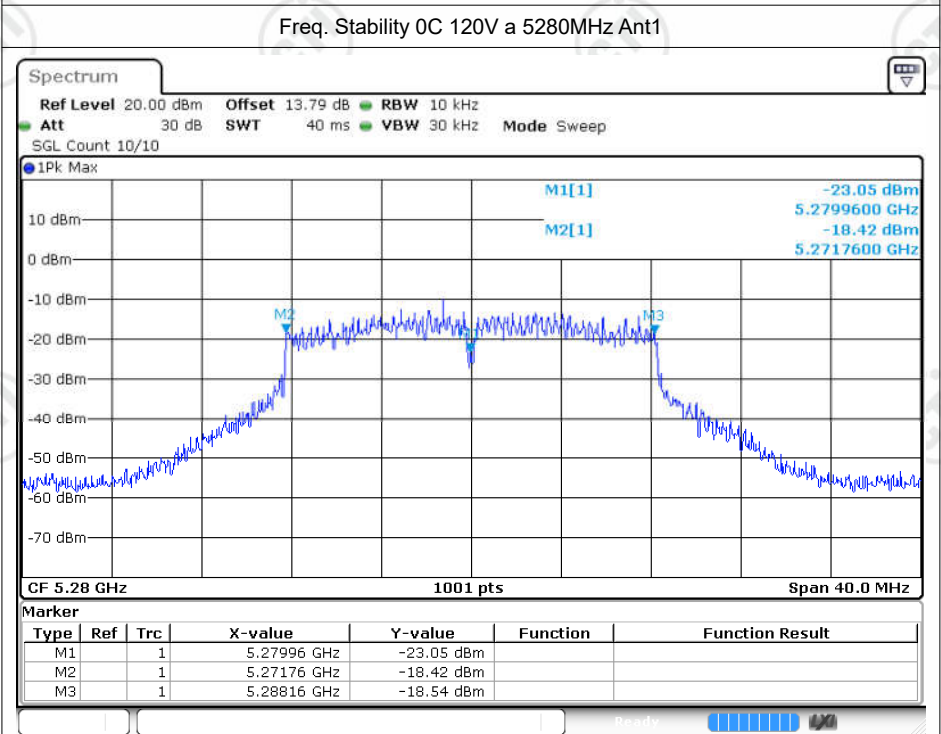


Date: 4.JAN.2025 13:39:57

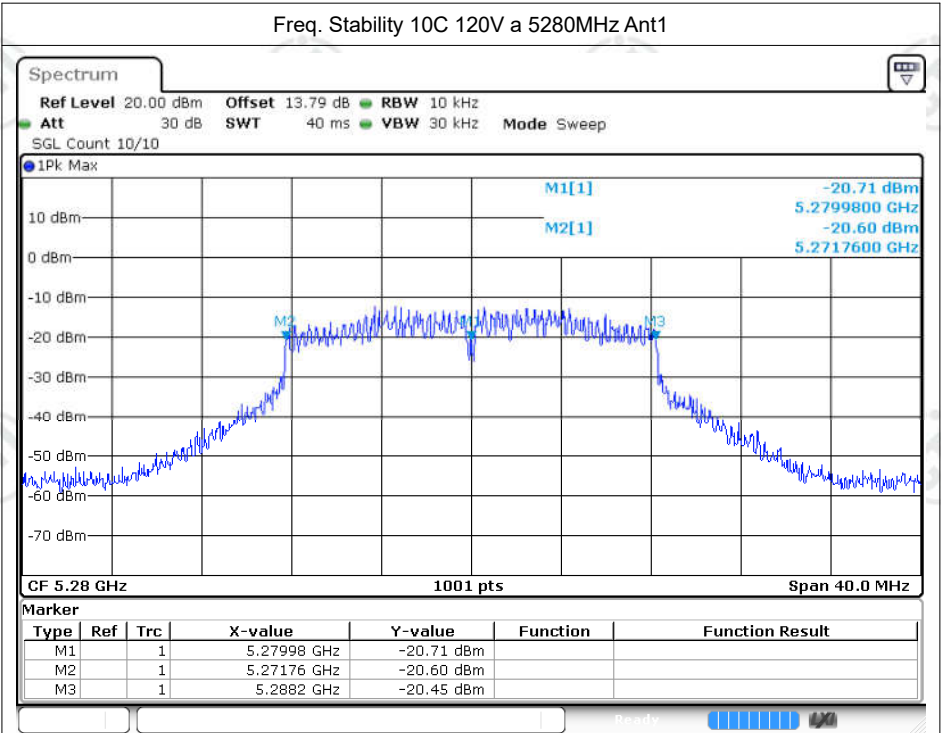


Date: 4.JAN.2025 13:40:00

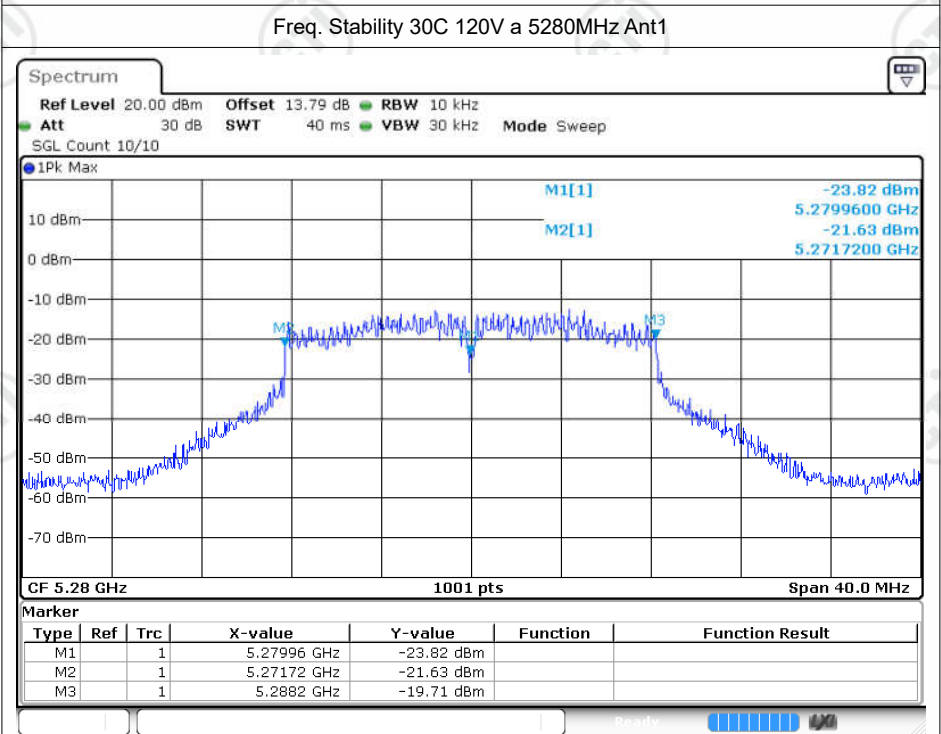


Date: 4.JAN.2025 13:40:06

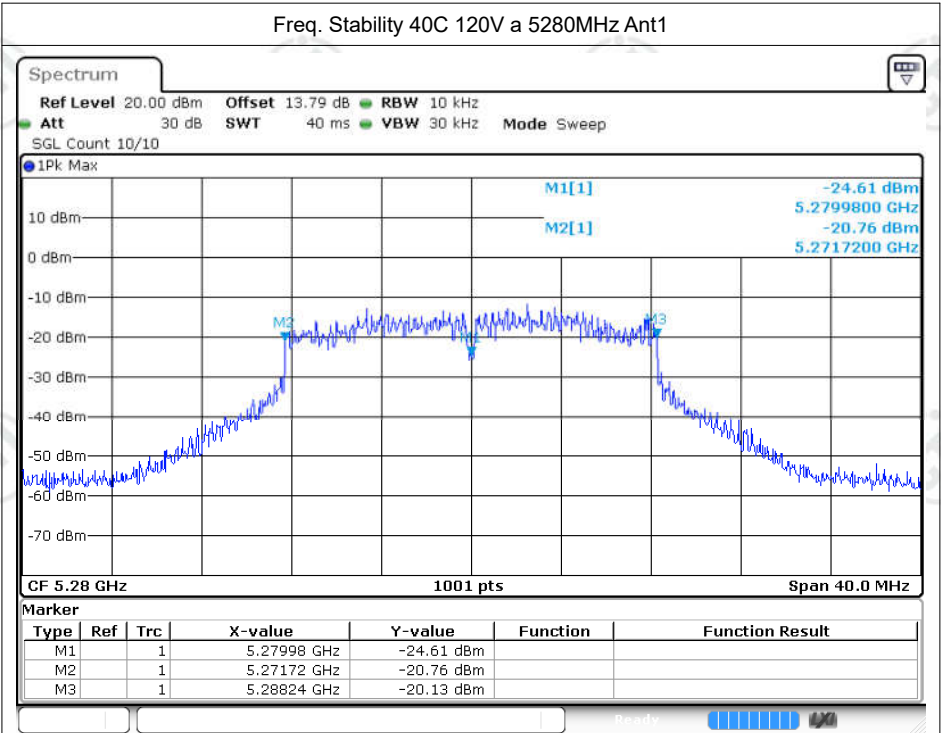


Date: 4.JAN.2025 13:40:09

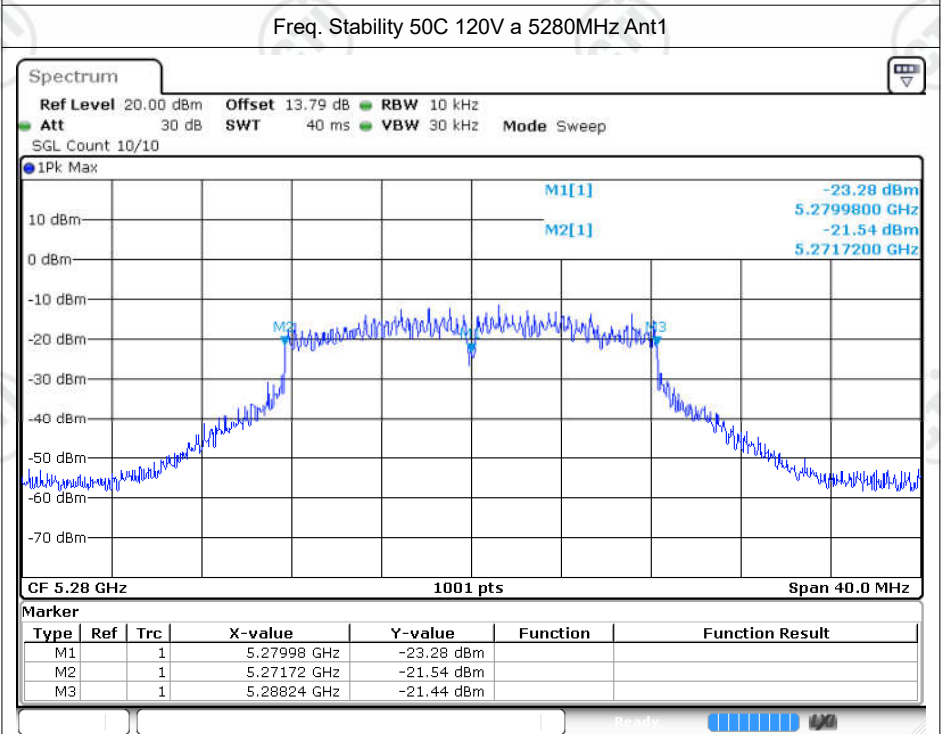


Date: 4.JAN.2025 13:40:12

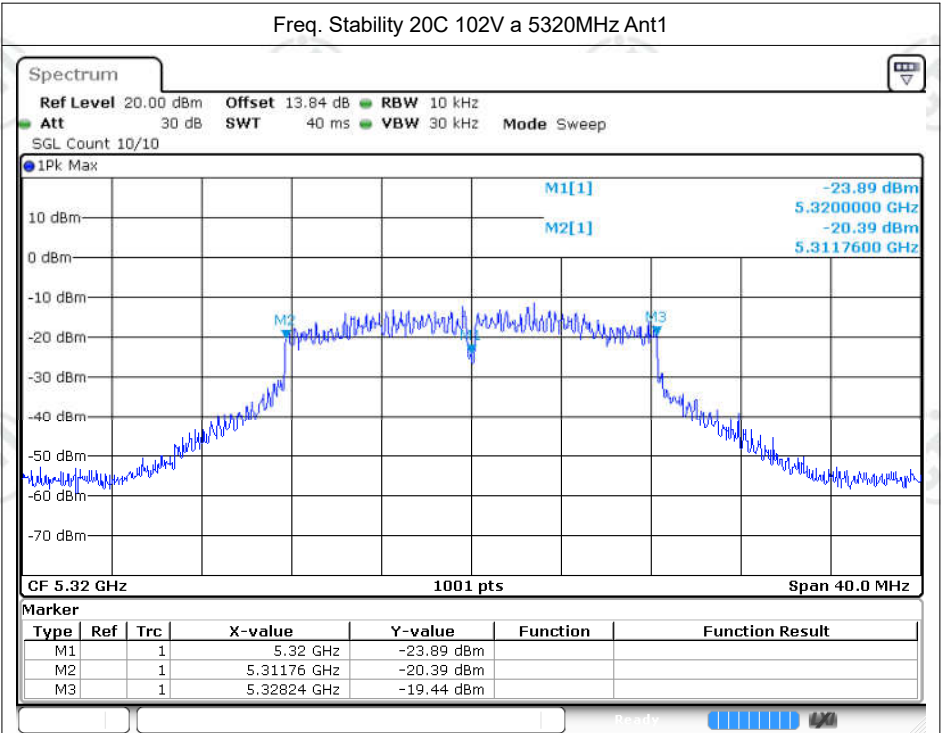


Date: 4.JAN.2025 13:41:01

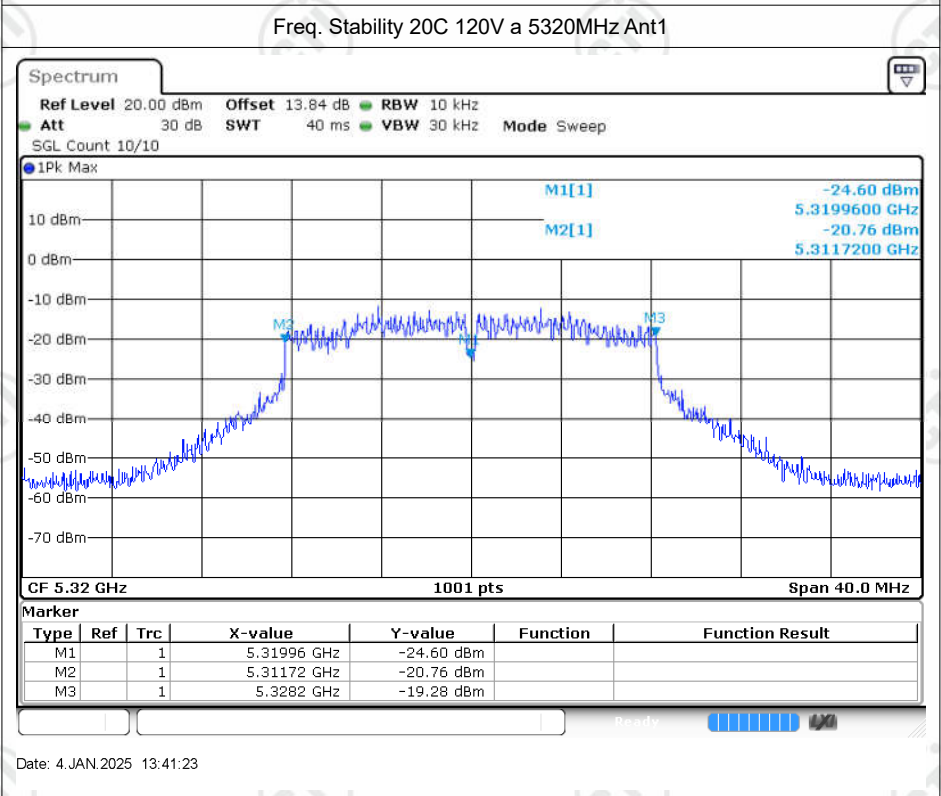


Date: 4.JAN.2025 13:41:23

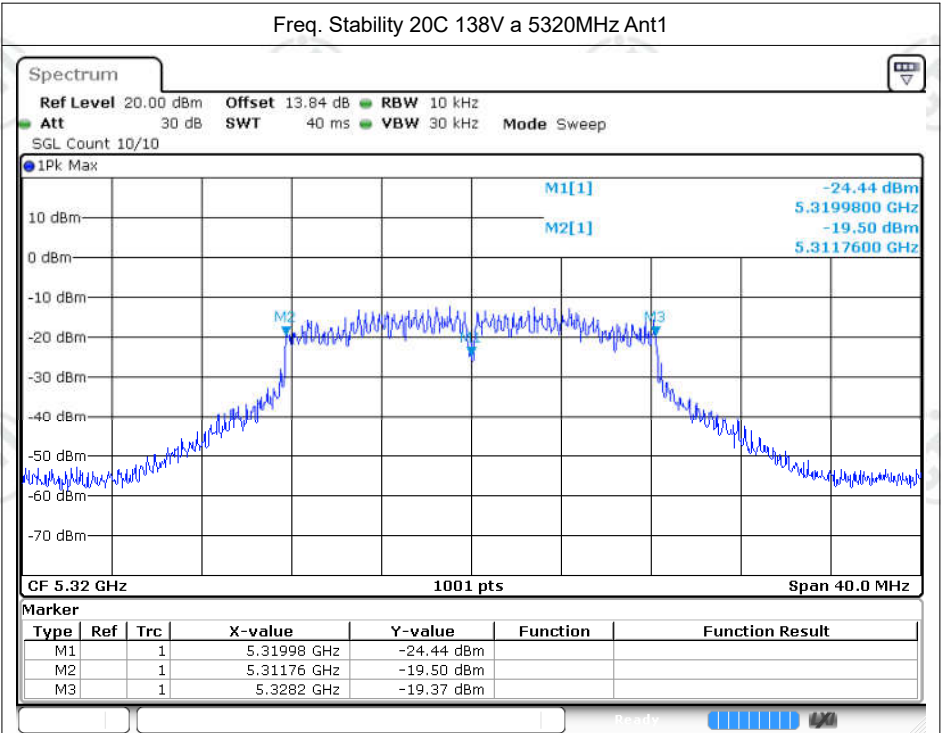


Date: 4.JAN.2025 13:41:07

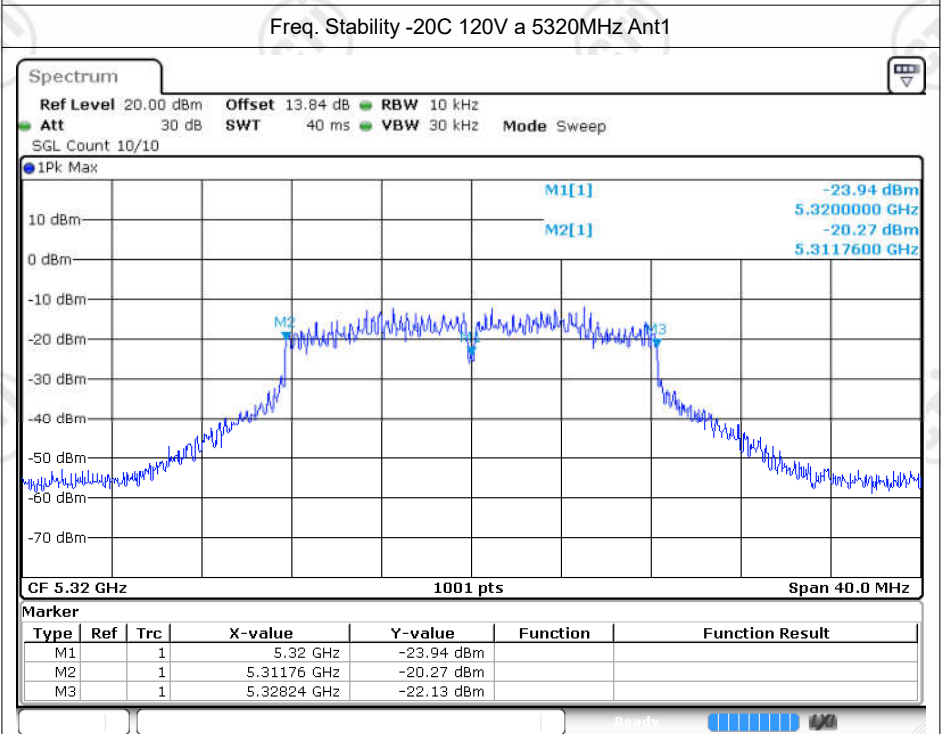


Date: 4.JAN.2025 13:41:11

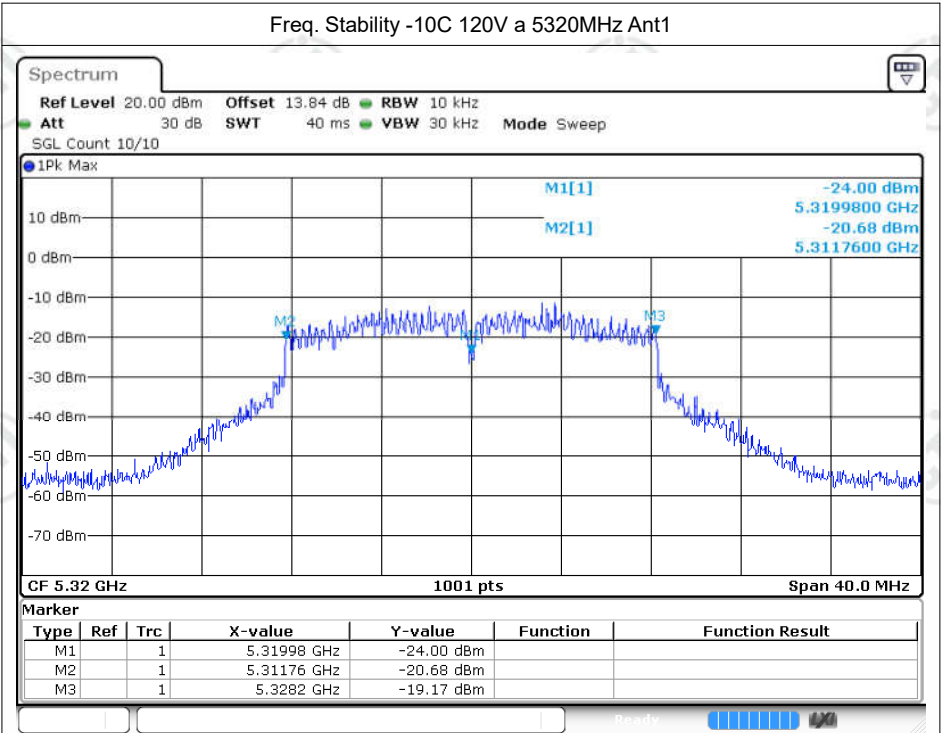


Date: 4.JAN.2025 13:41:14

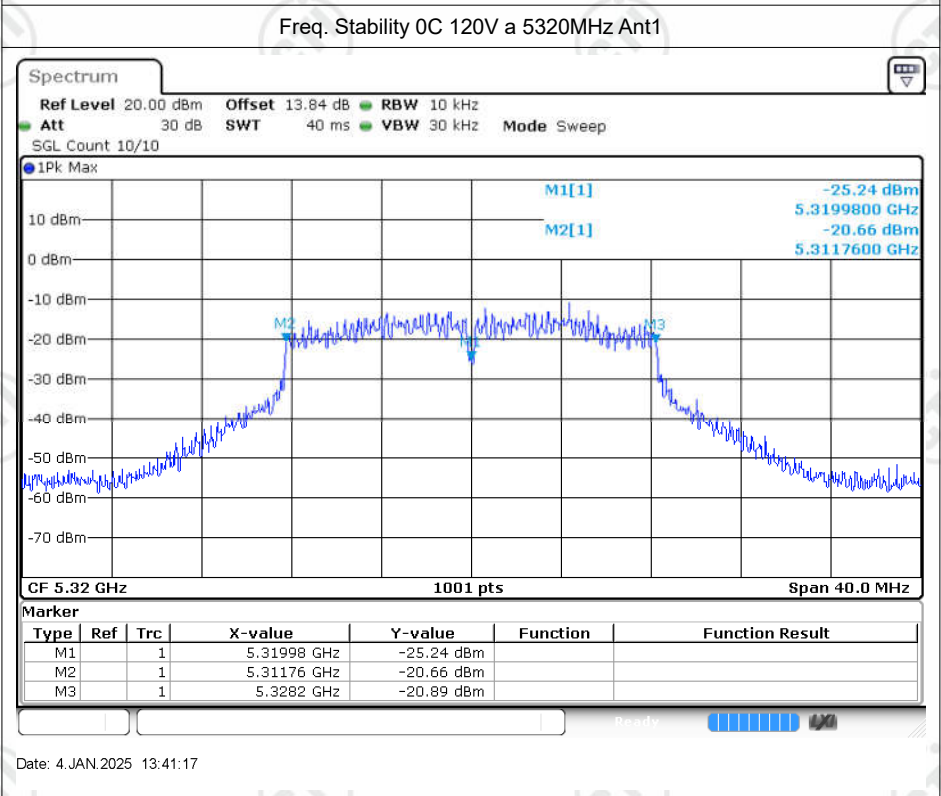


Date: 4.JAN.2025 13:41:17

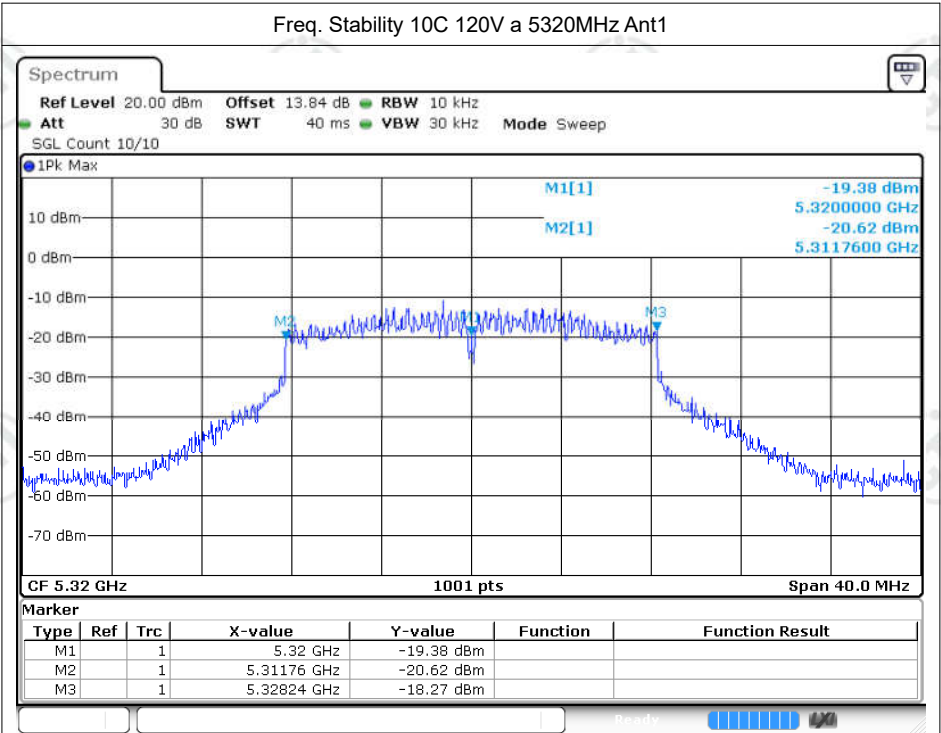


Date: 4.JAN.2025 13:41:20

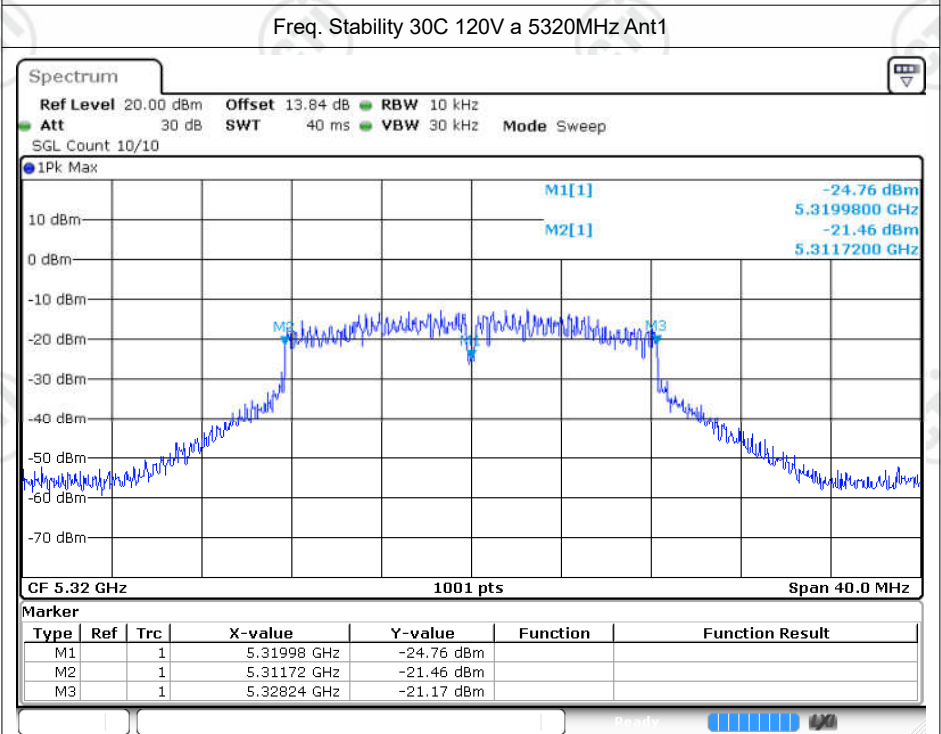


Date: 4.JAN.2025 13:41:26

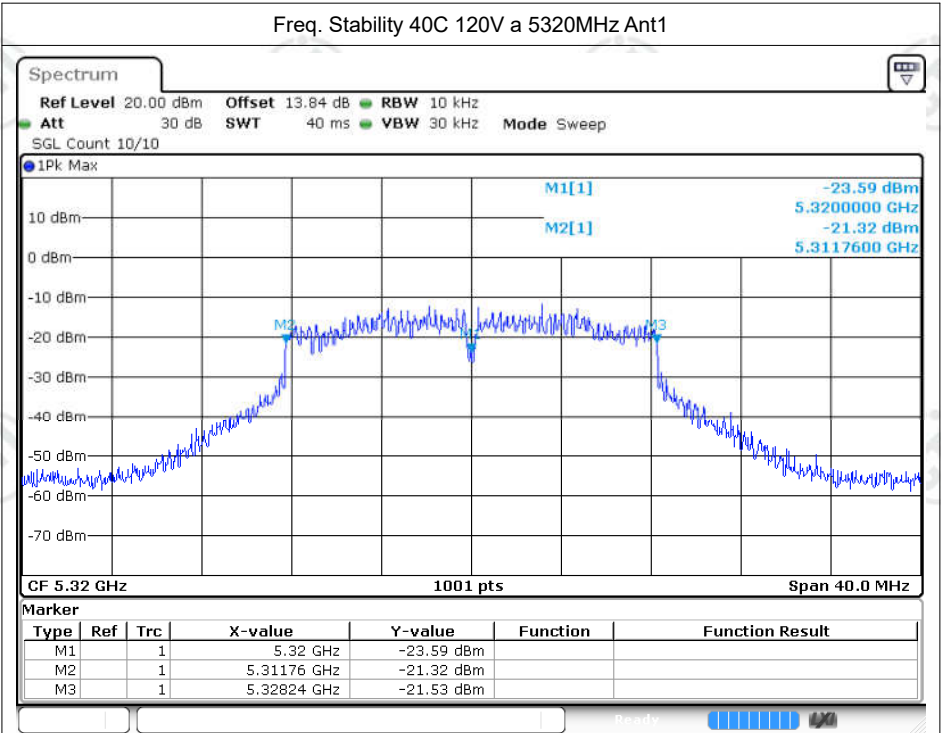


Date: 4.JAN.2025 13:41:29

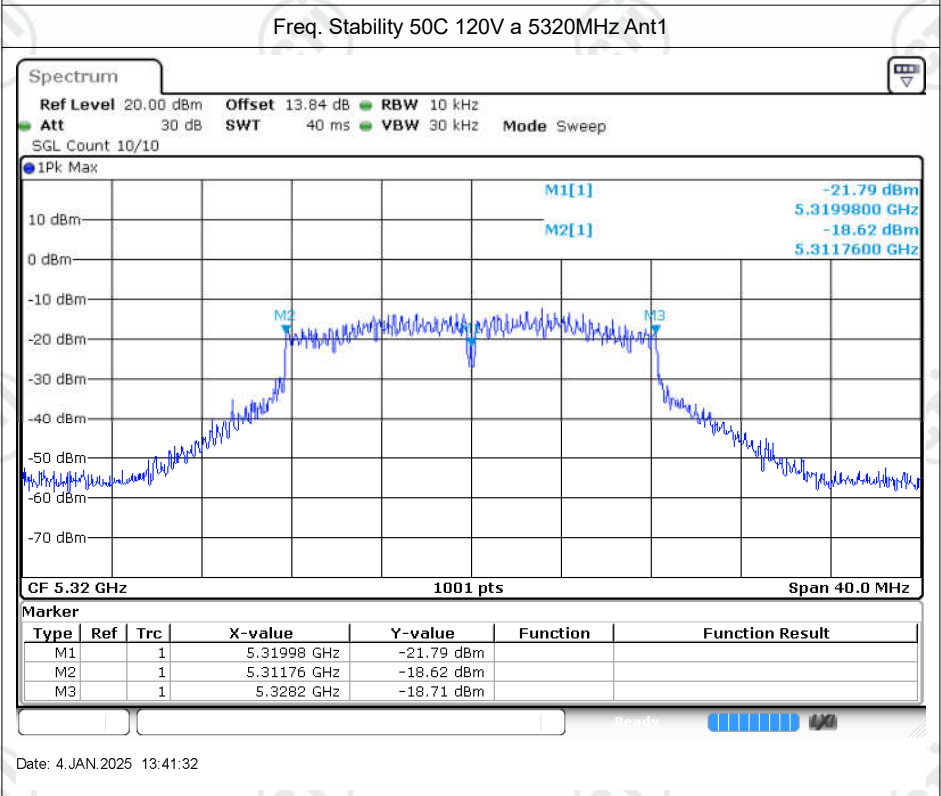


Date: 4.JAN.2025 13:41:32

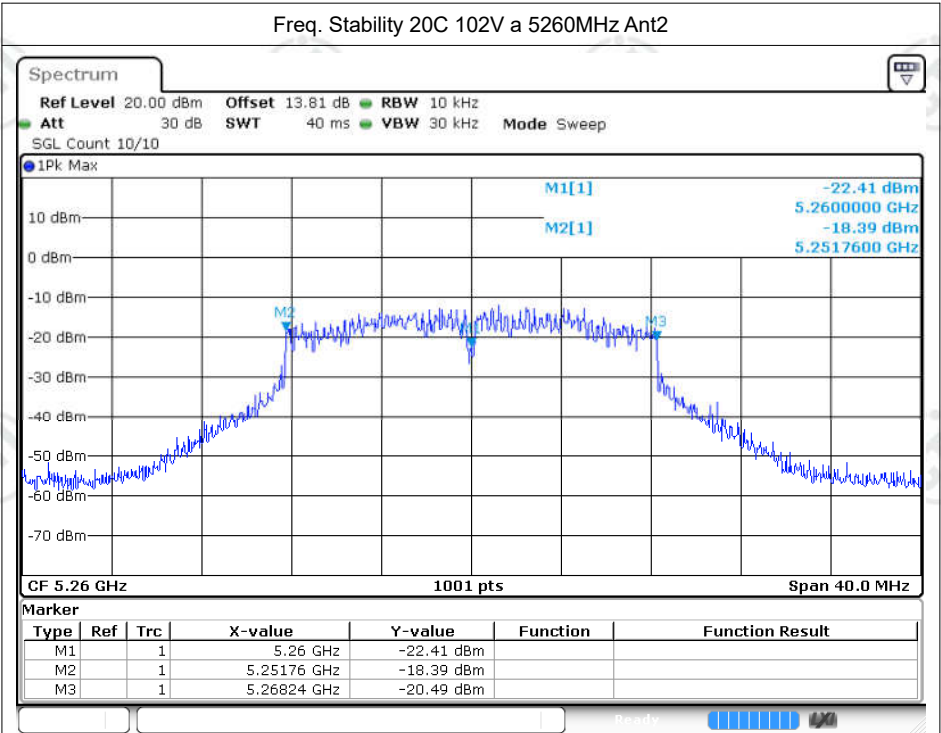


Date: 4.JAN.2025 14:06:33

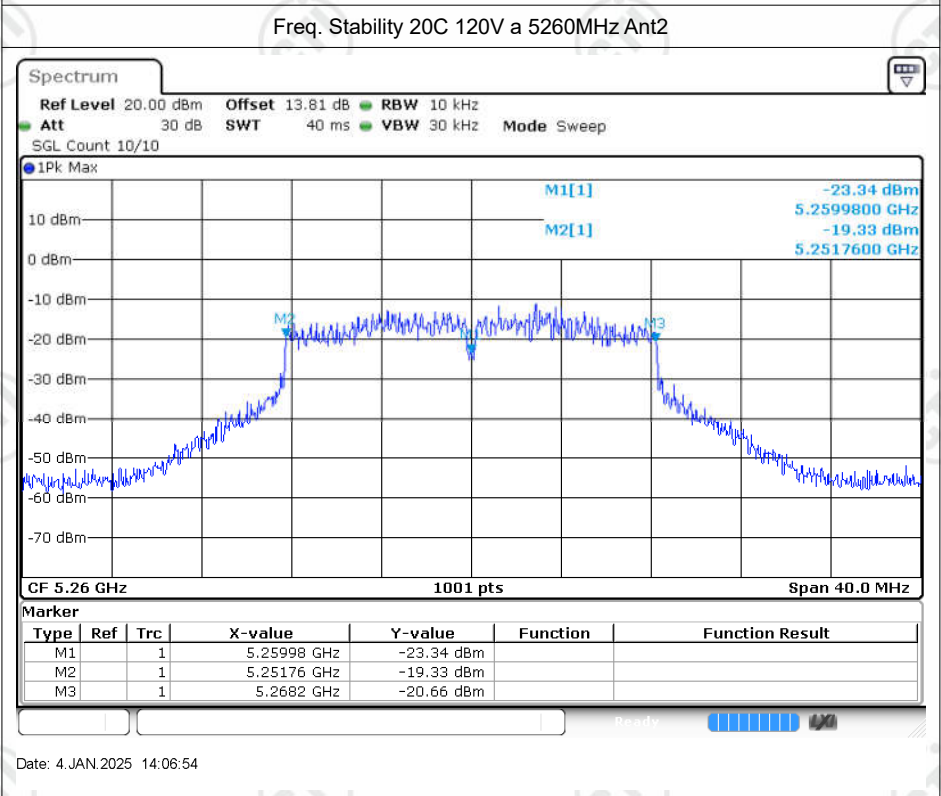


Date: 4.JAN.2025 14:06:54

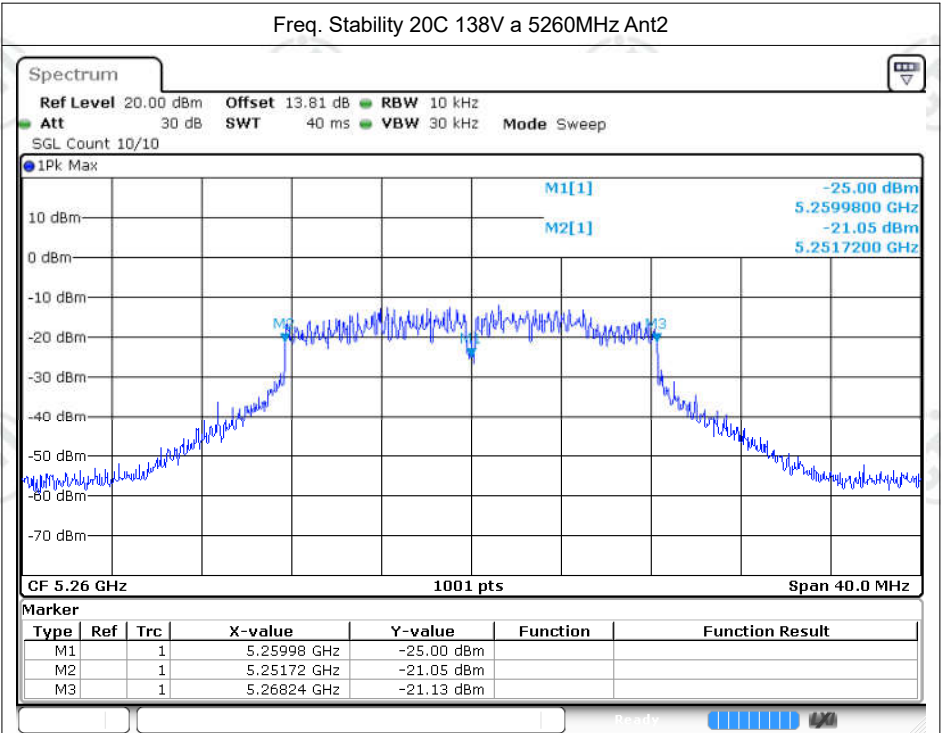


Date: 4.JAN.2025 14:06:39

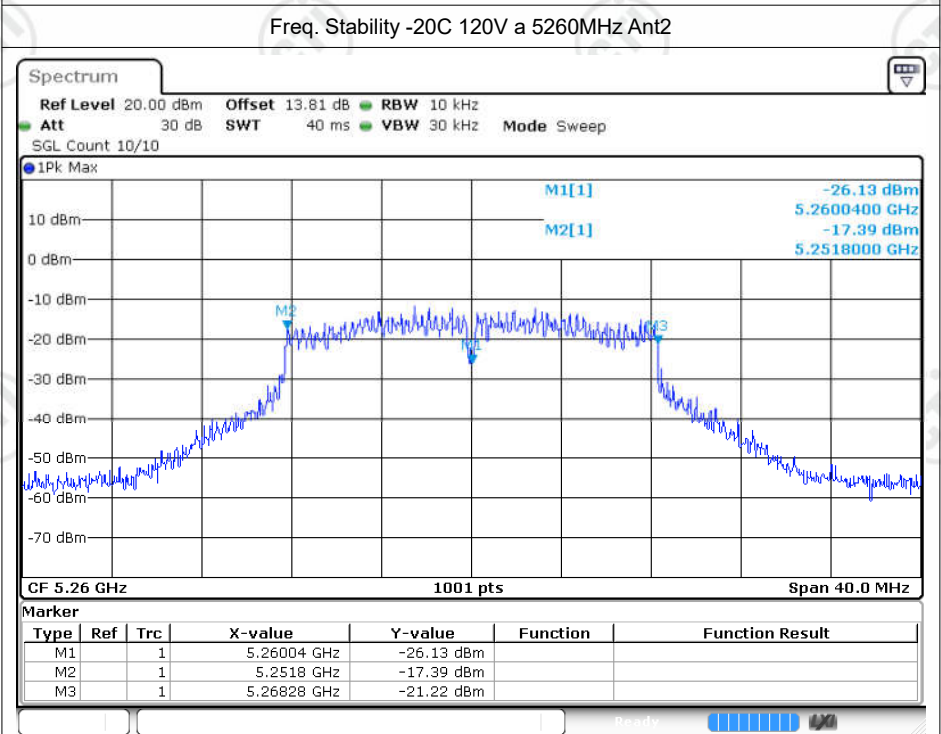


Date: 4.JAN.2025 14:06:42

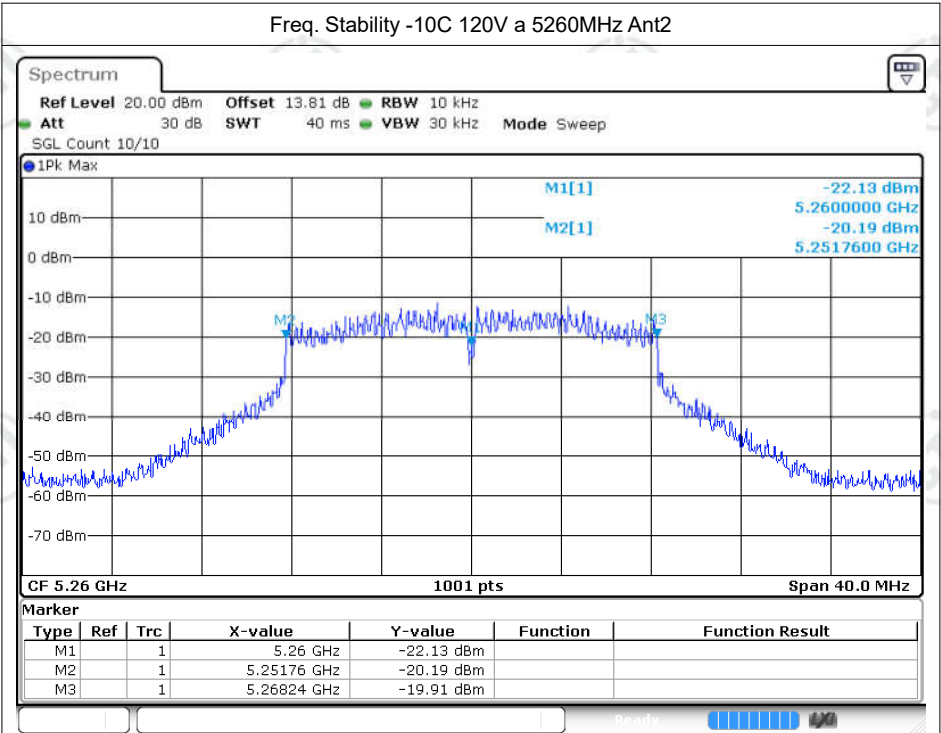


Date: 4.JAN.2025 14:06:45

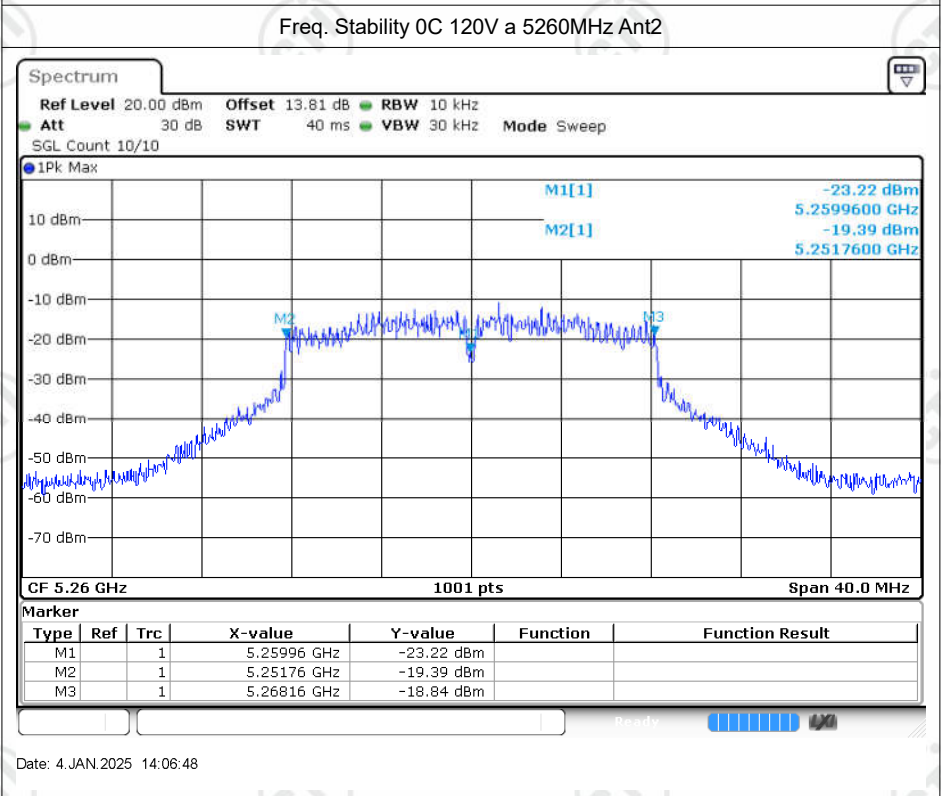


Date: 4.JAN.2025 14:06:48

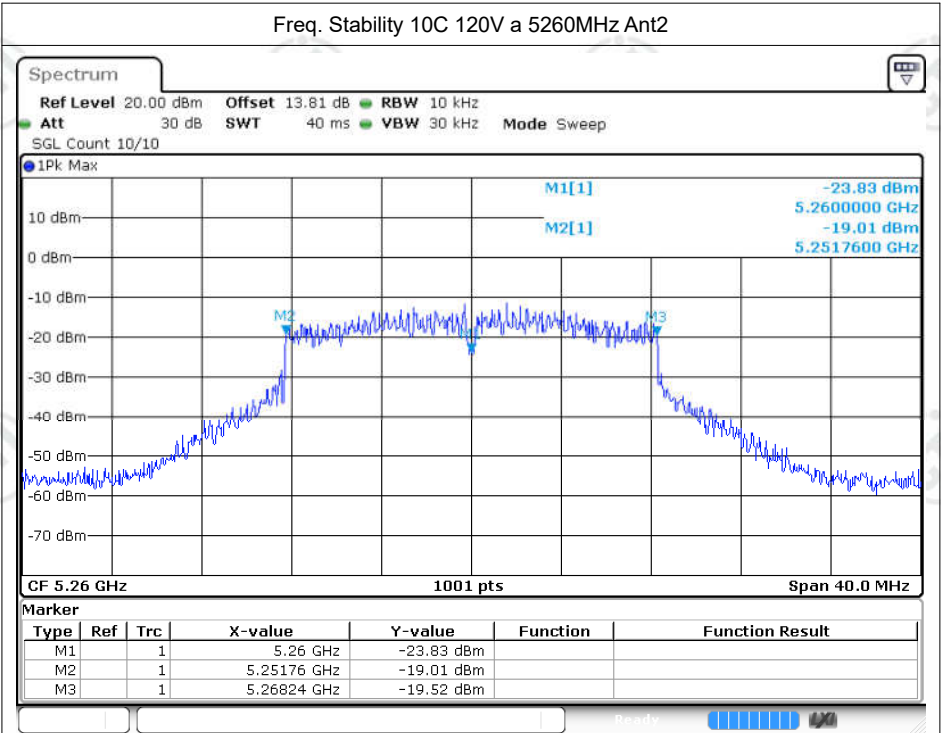


Date: 4.JAN.2025 14:06:51

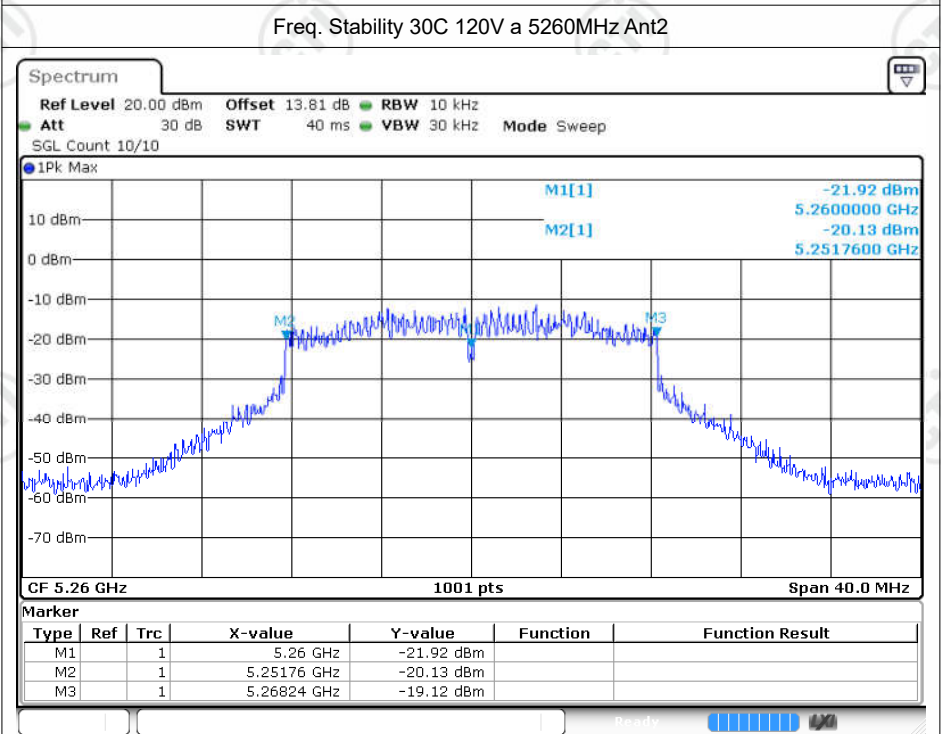


Date: 4.JAN.2025 14:06:58

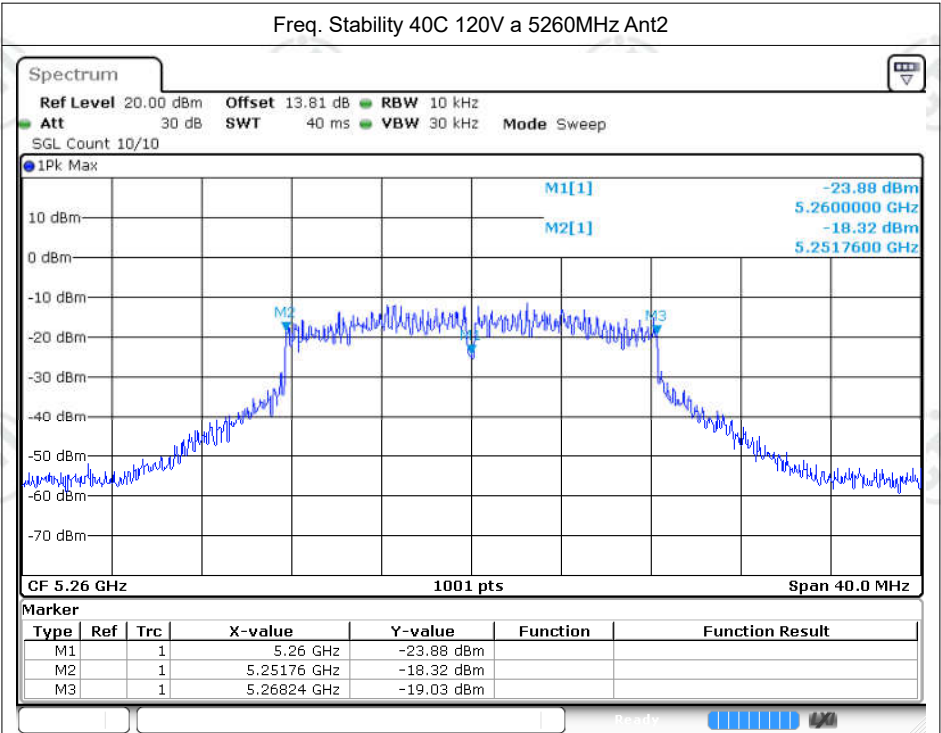


Date: 4.JAN.2025 14:07:01

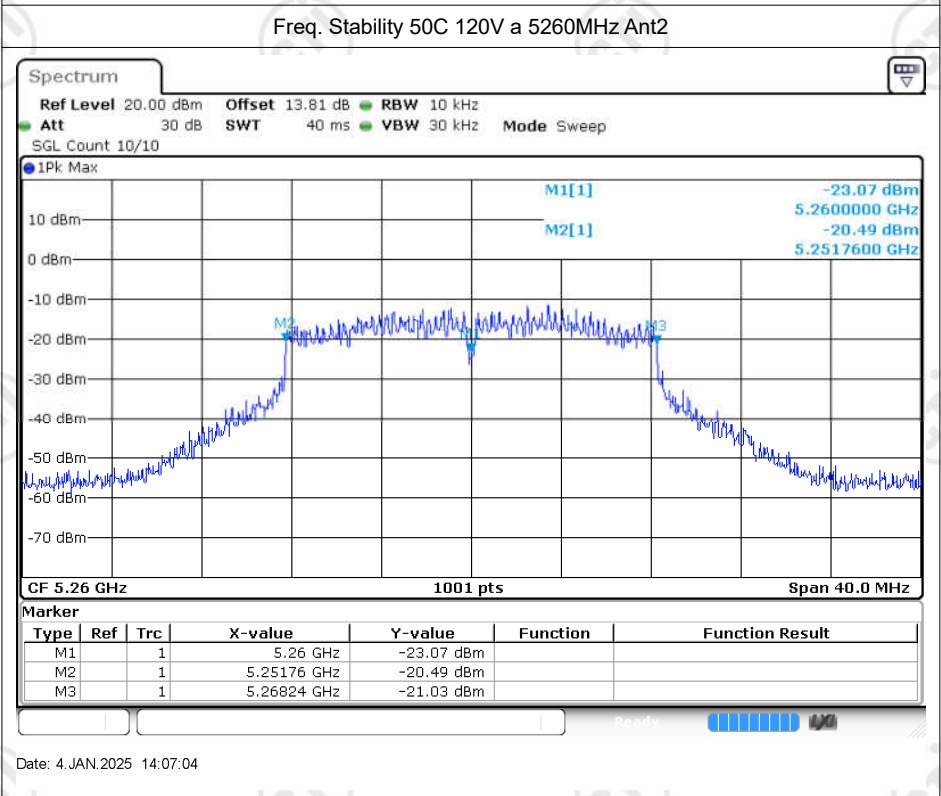


Date: 4.JAN.2025 14:07:04

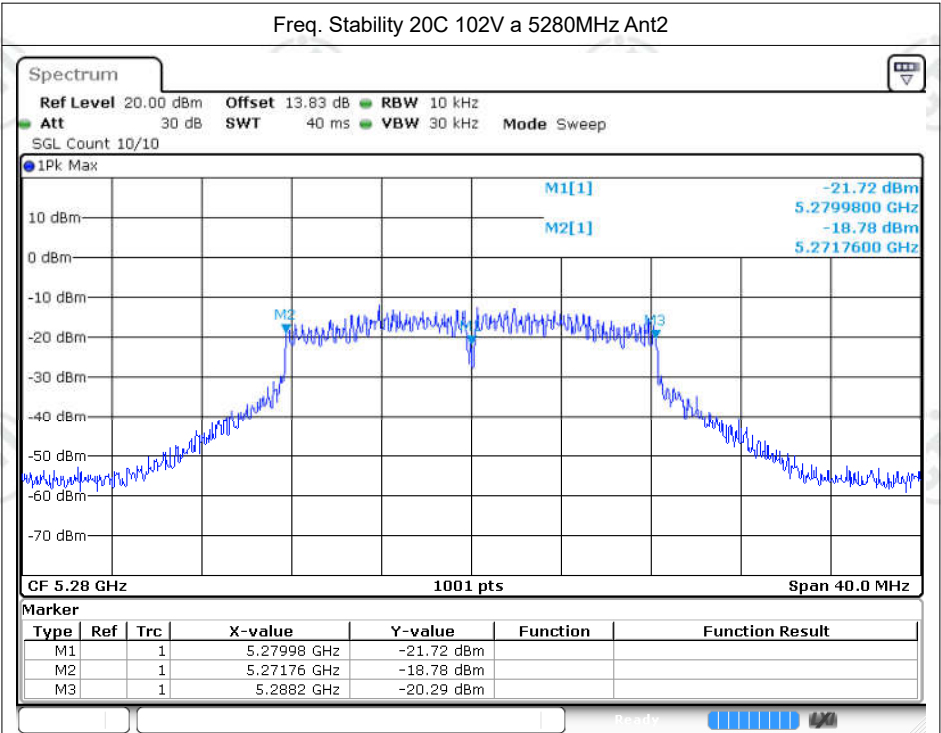


Date: 4.JAN.2025 14:08:24

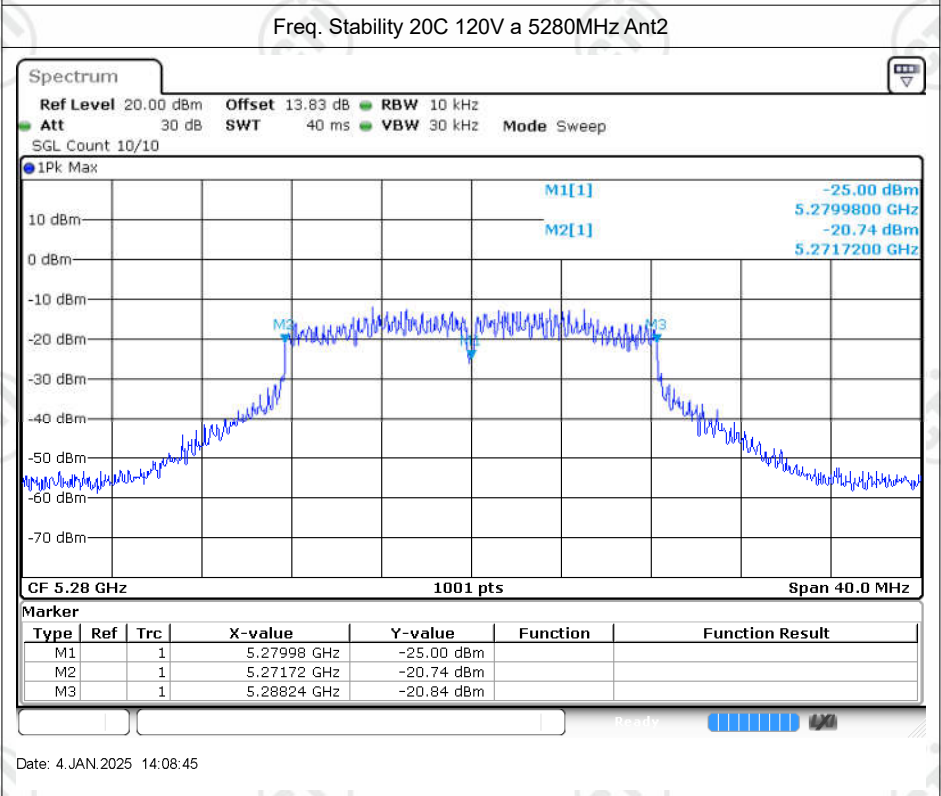


Date: 4.JAN.2025 14:08:45

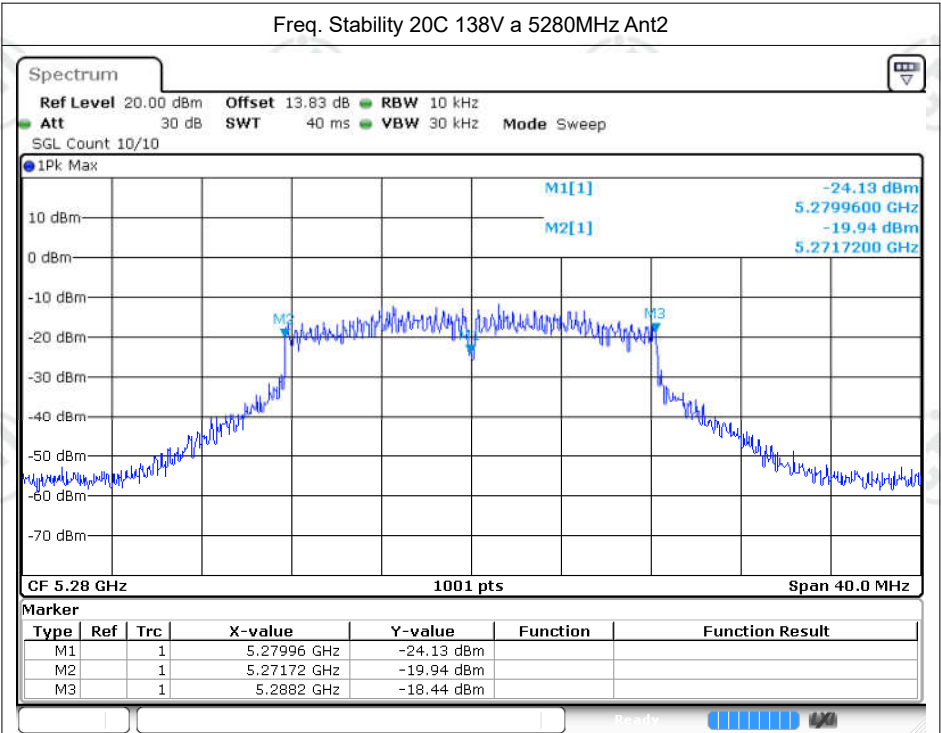


Date: 4.JAN.2025 14:08:30

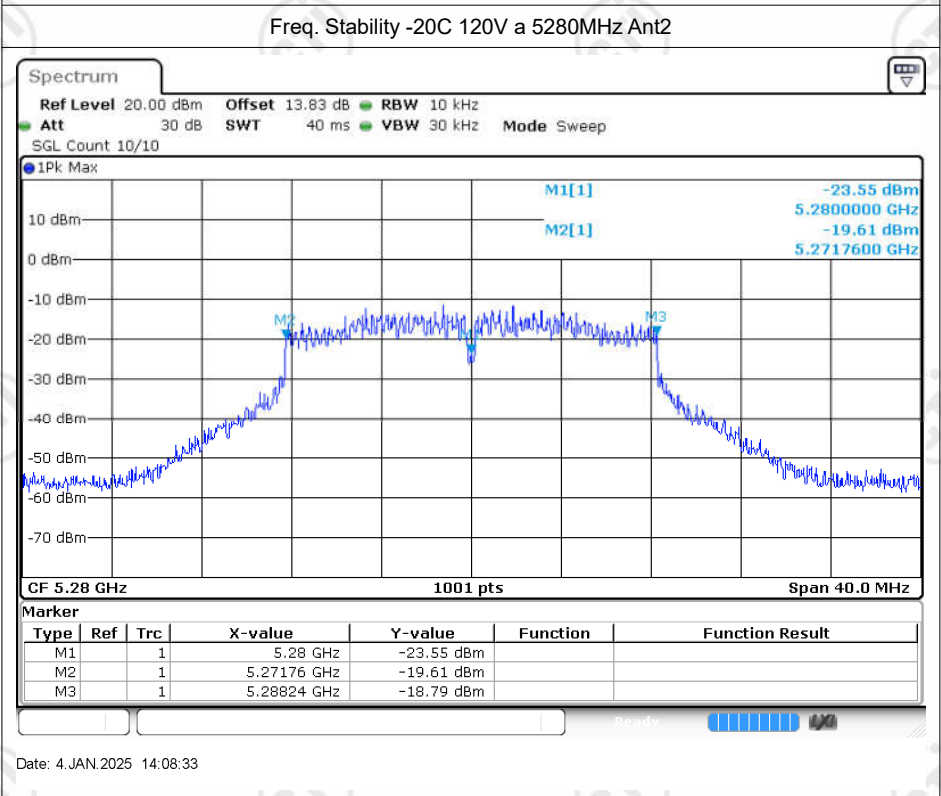


Date: 4.JAN.2025 14:08:33

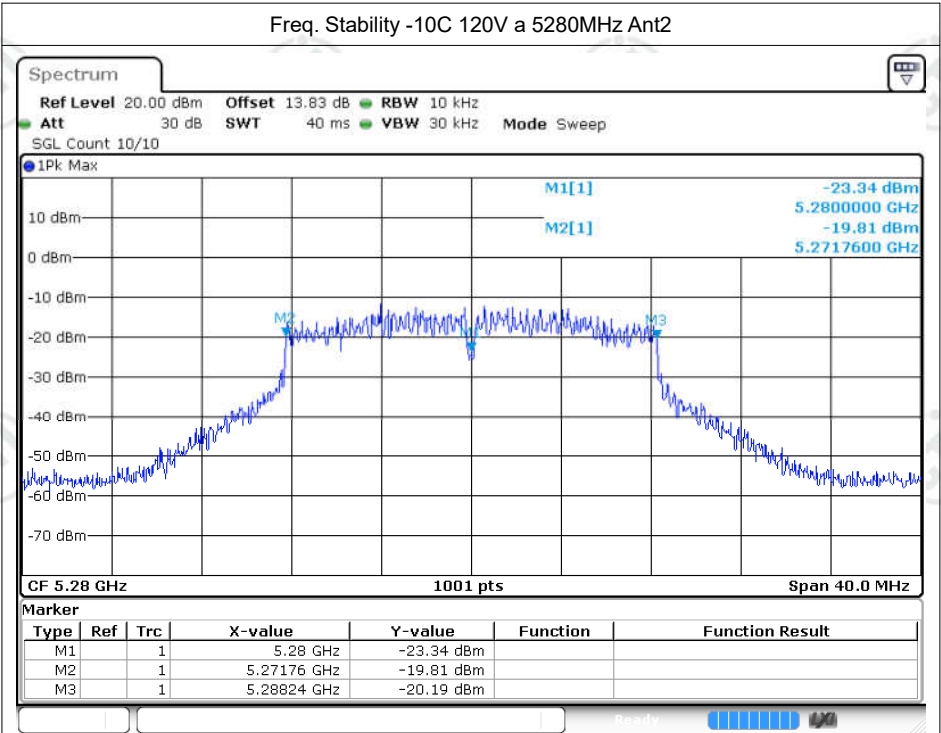


Date: 4.JAN.2025 14:08:36

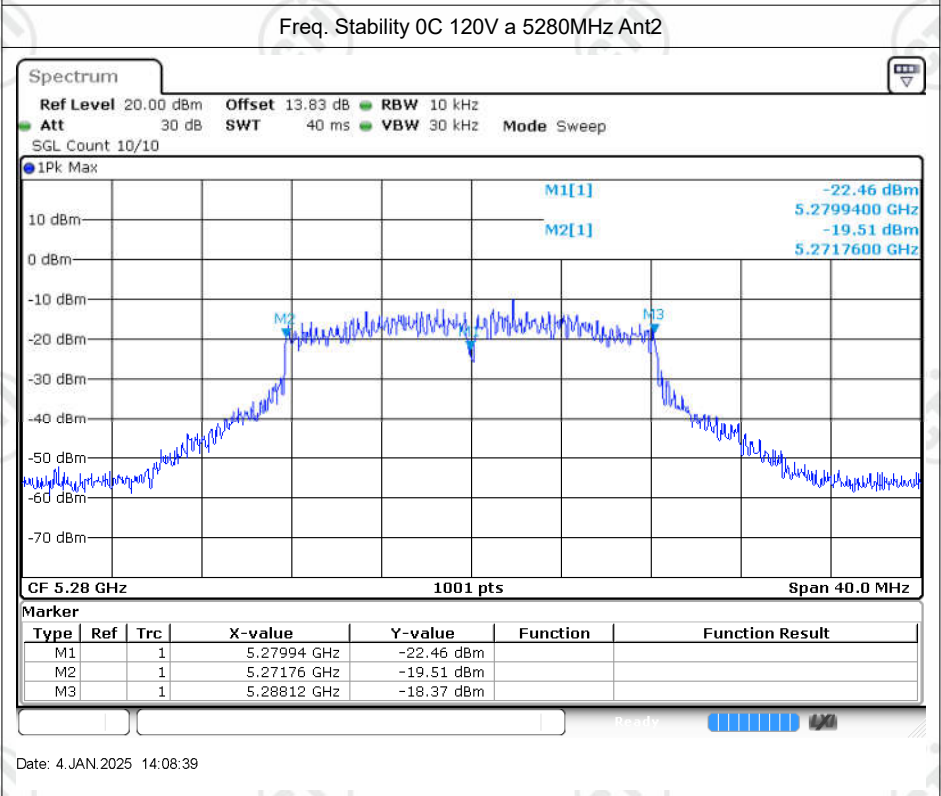


Date: 4.JAN.2025 14:08:39

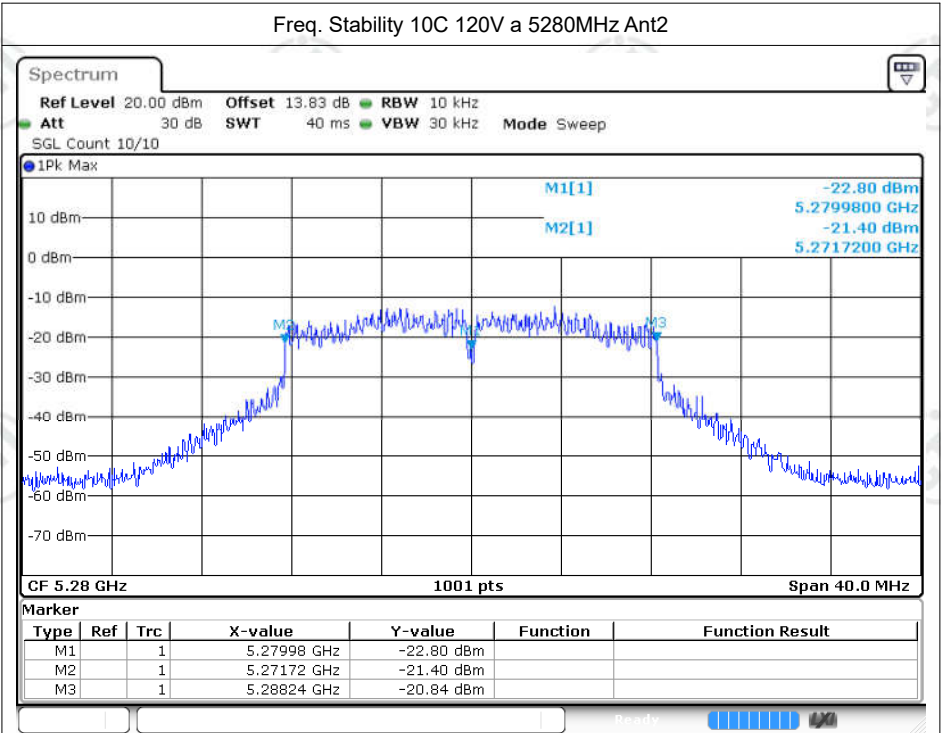


Date: 4.JAN.2025 14:08:42

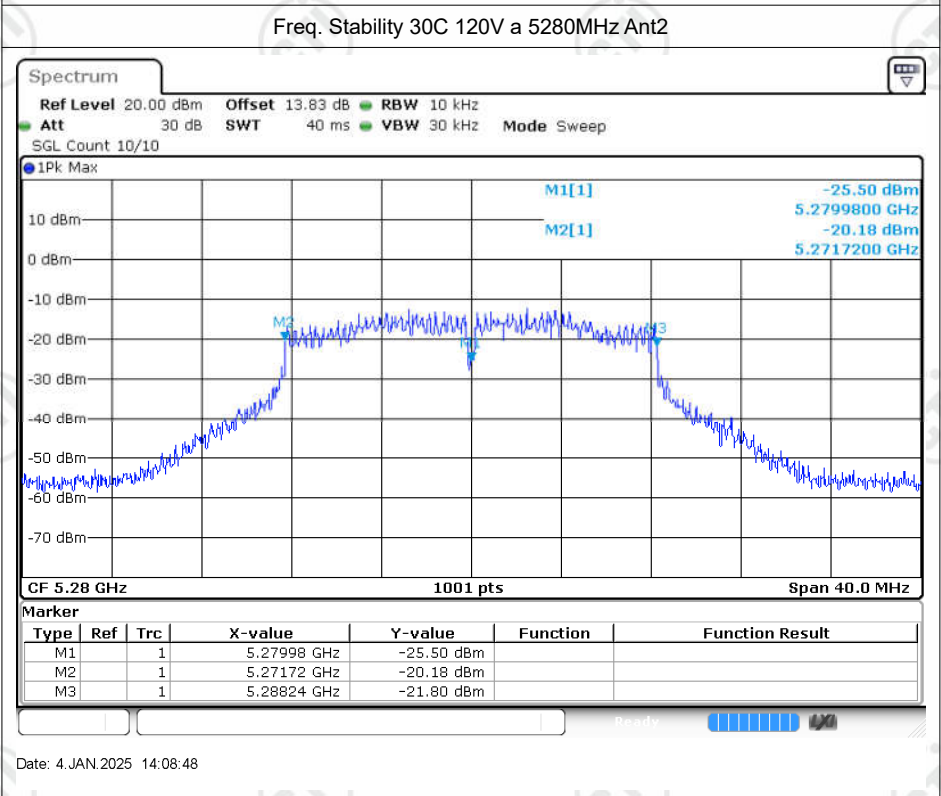


Date: 4.JAN.2025 14:08:48

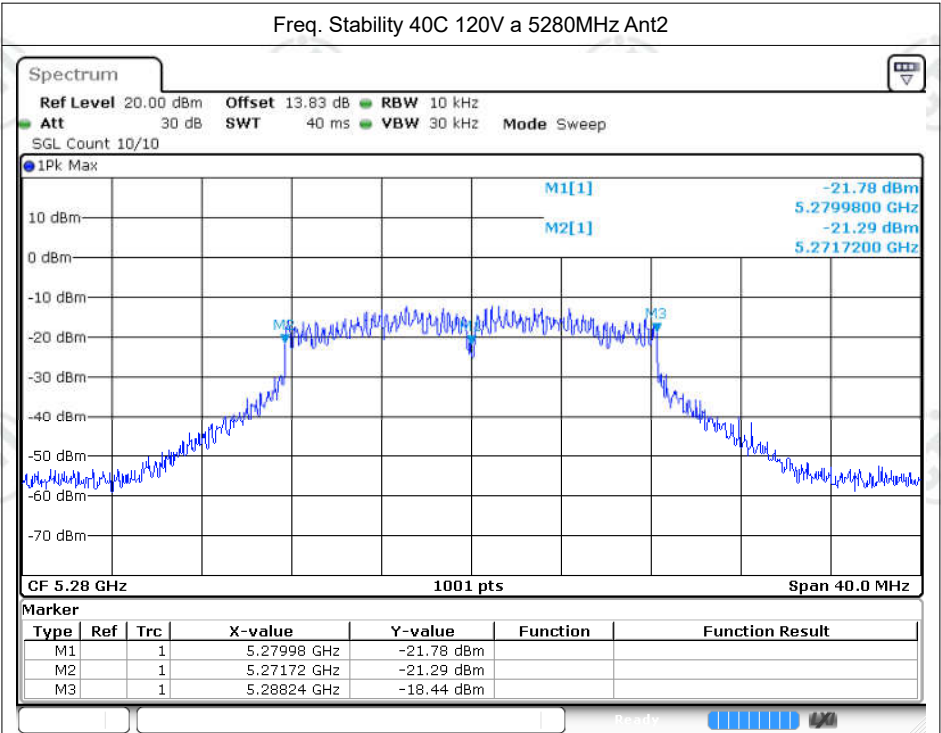


Date: 4.JAN.2025 14:08:51

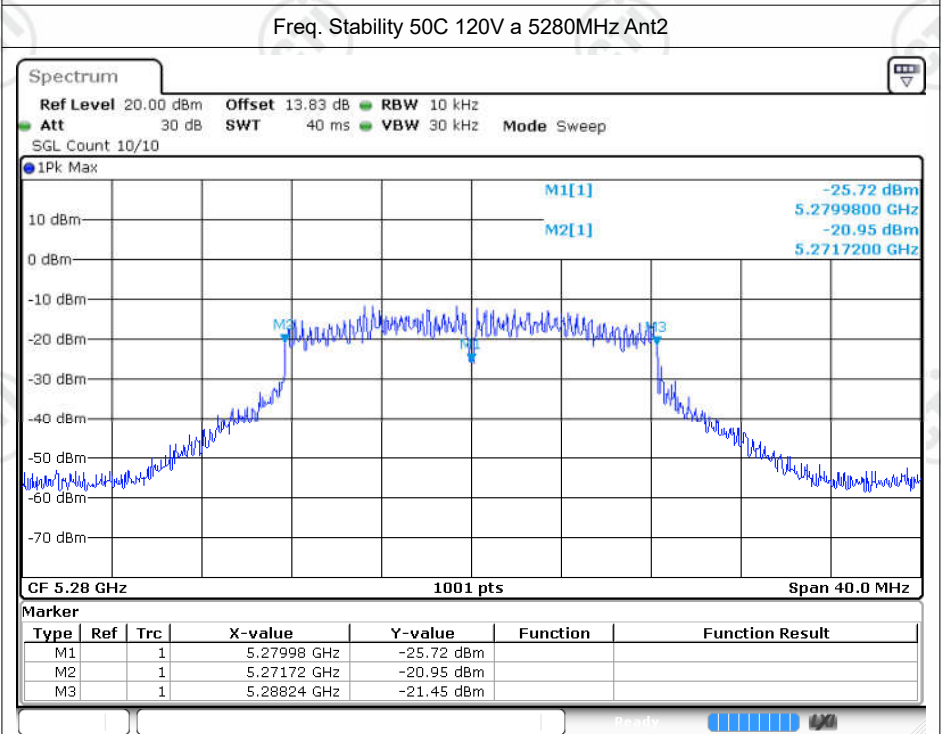


Date: 4.JAN.2025 14:08:54

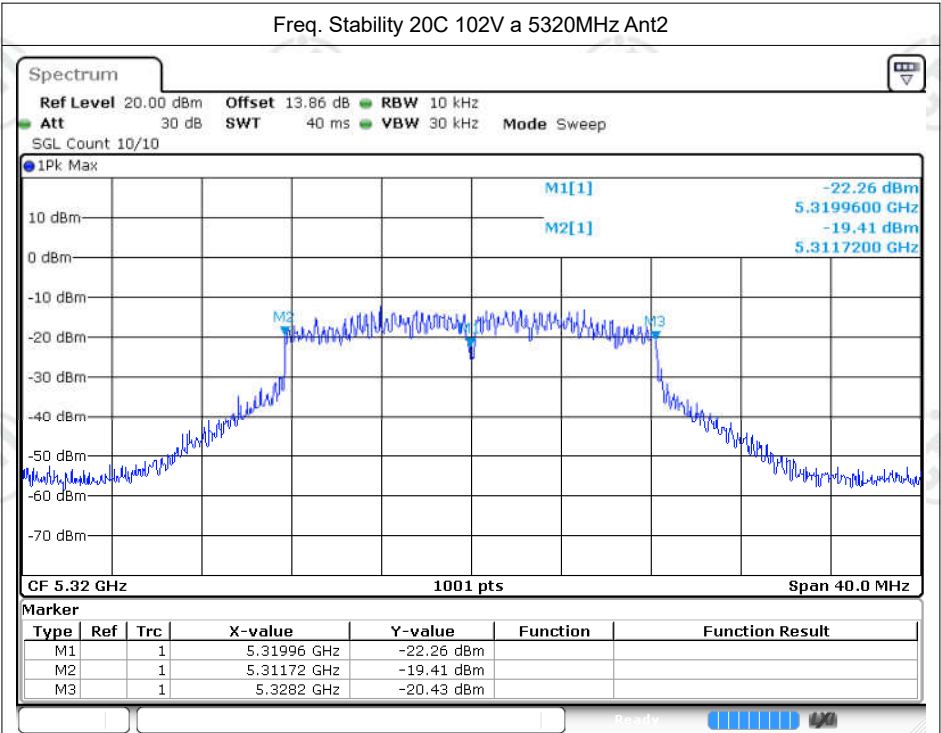


Date: 4.JAN.2025 14:09:41

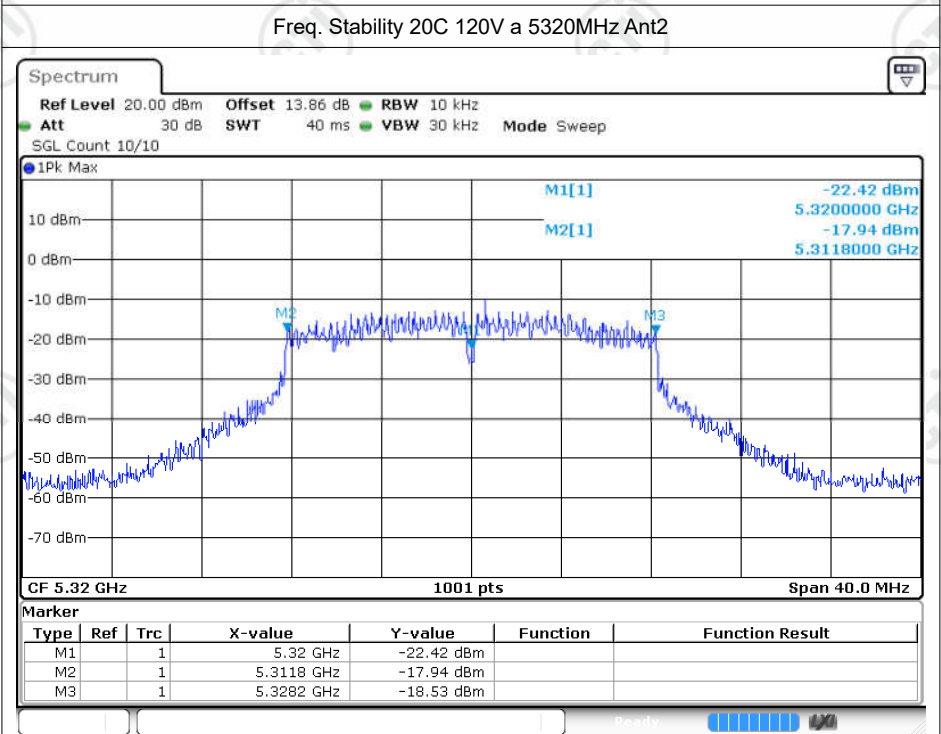

Date: 4.JAN.2025 14:10:02

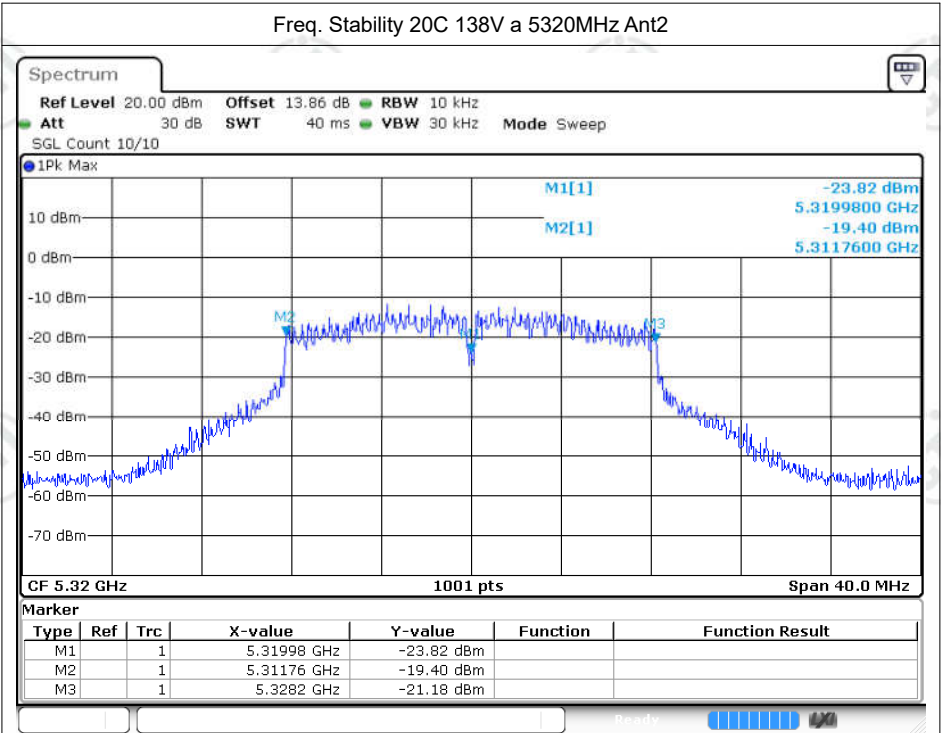

Date: 4.JAN.2025 14:09:47

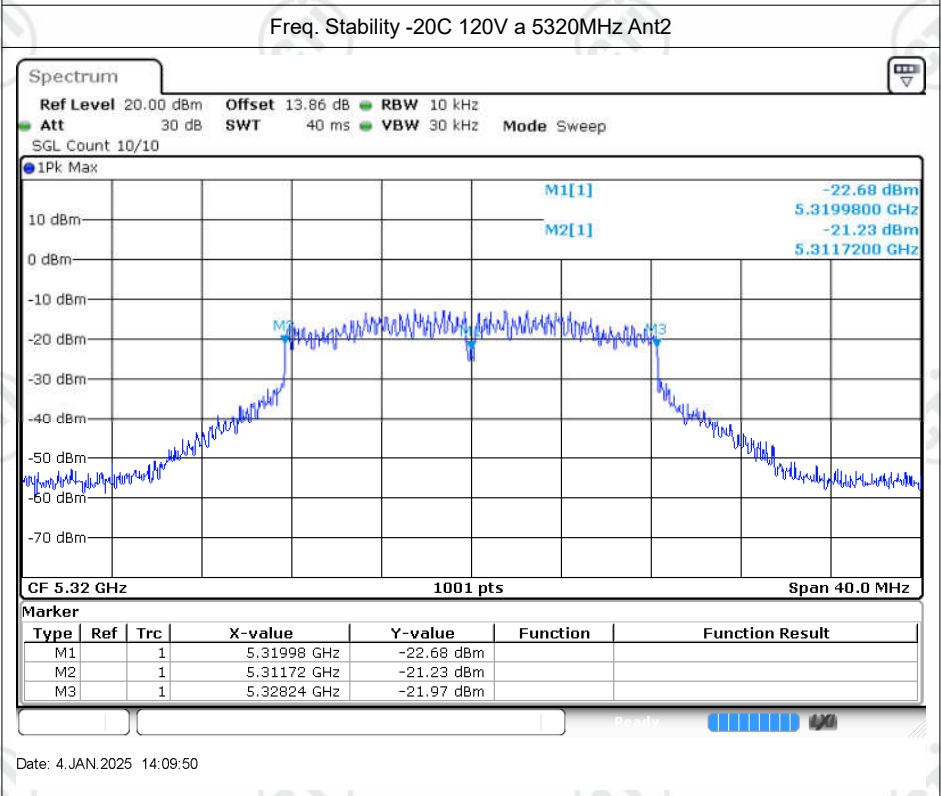

Date: 4.JAN.2025 14:09:50