




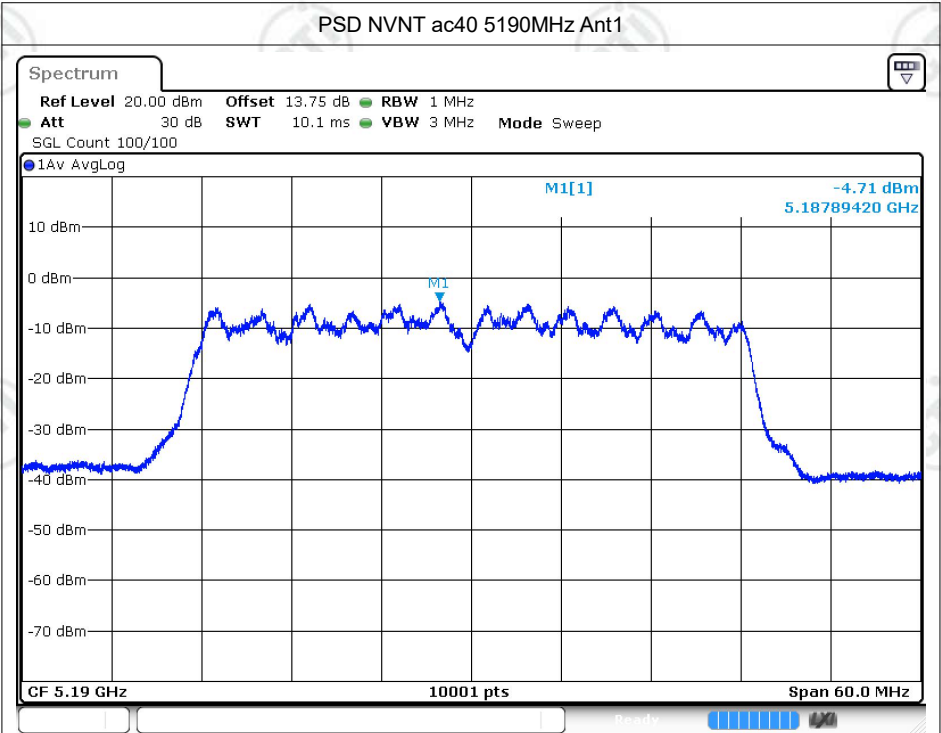


Date: 8.APR.2023 14:37:33

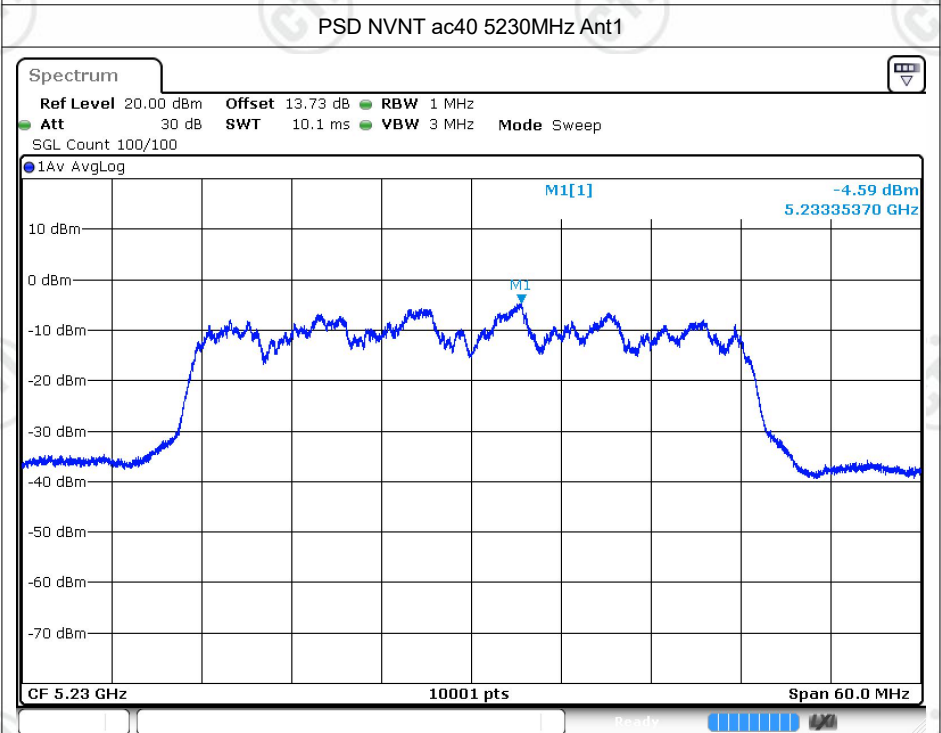


Date: 8.APR.2023 14:39:32

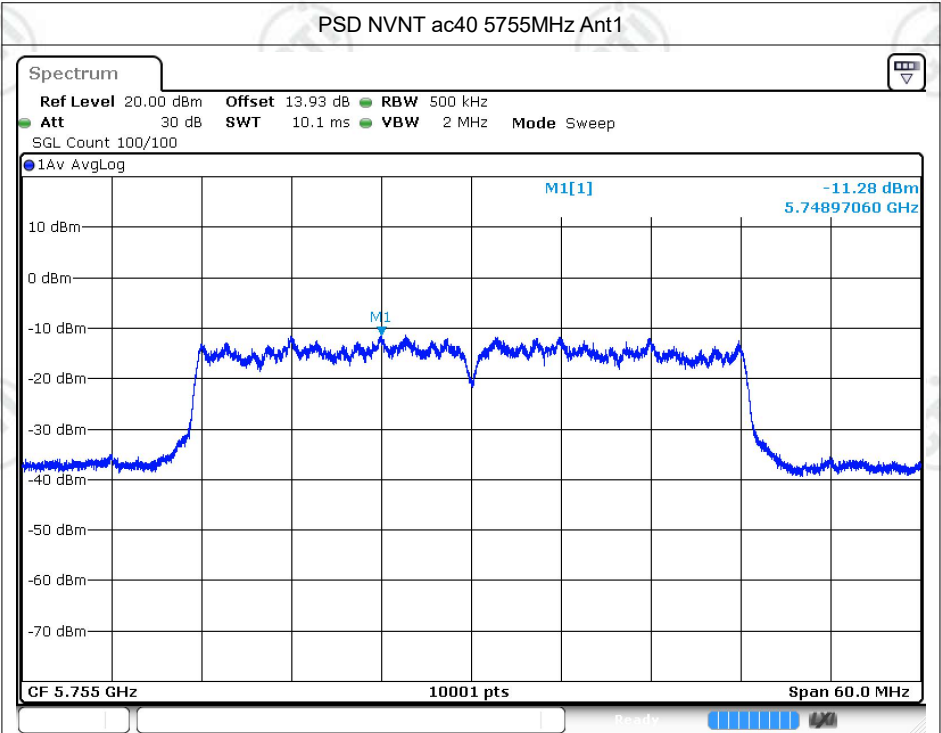


Date: 8.APR.2023 14:43:16

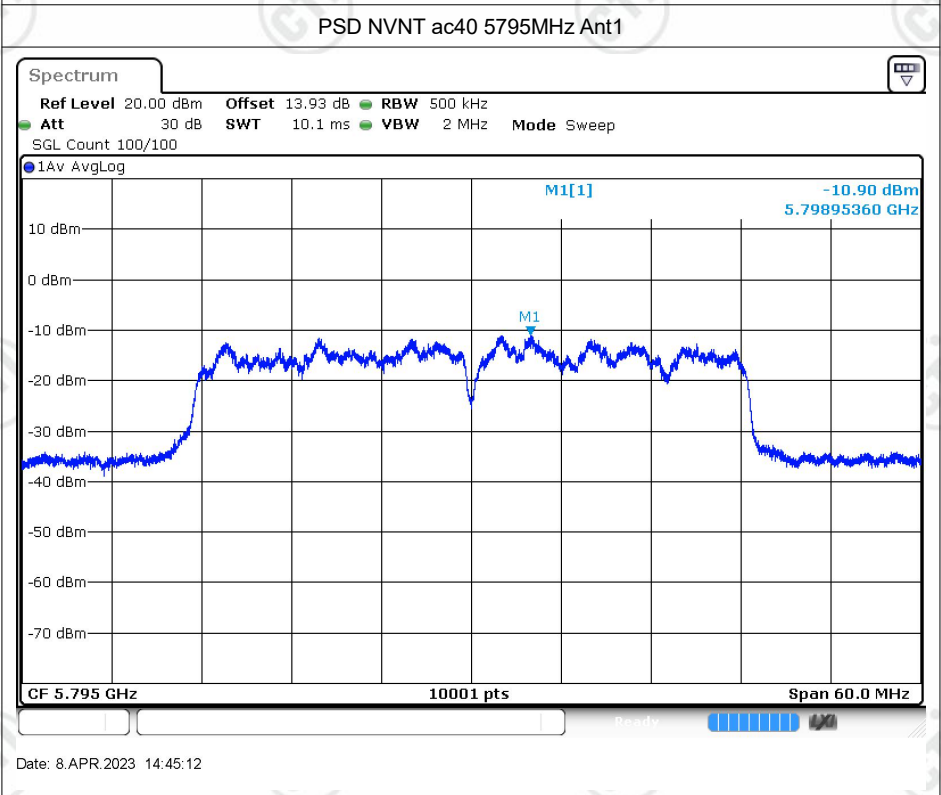

Date: 8.APR.2023 14:45:12

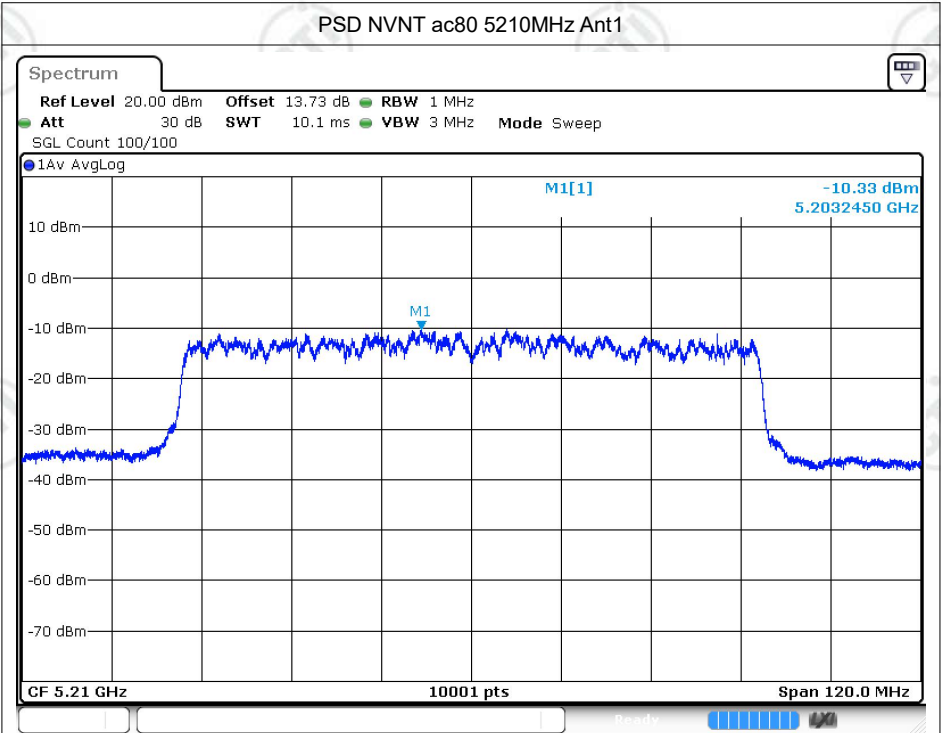

Date: 8.APR.2023 14:50:15

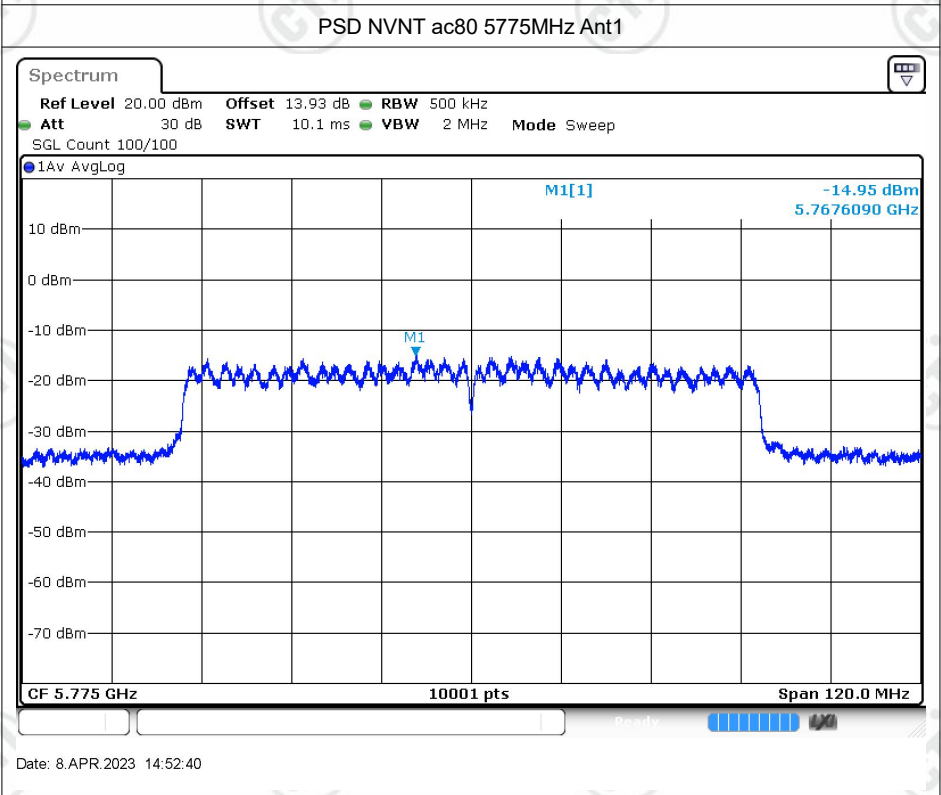

Date: 8.APR.2023 14:52:40

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	Ant1	5180	0	0	25	Pass
20C 120V	a	5180	Ant1	5180	0	0	25	Pass
20C 138V	a	5180	Ant1	5180	0	0	25	Pass
-20C 120V	a	5180	Ant1	5180	0	0	25	Pass
-10C 120V	a	5180	Ant1	5180	0	0	25	Pass
0C 120V	a	5180	Ant1	5180	0	0	25	Pass
10C 120V	a	5180	Ant1	5180	0	0	25	Pass
30C 120V	a	5180	Ant1	5180	0	0	25	Pass
40C 120V	a	5180	Ant1	5180	0	0	25	Pass
50C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 102V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 138V	a	5240	Ant1	5240	0	0	25	Pass
-20C 120V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
-10C 120V	a	5240	Ant1	5240	0	0	25	Pass
0C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	a	5240	Ant1	5240	0	0	25	Pass
30C 120V	a	5240	Ant1	5240	0	0	25	Pass
40C 120V	a	5240	Ant1	5240	0	0	25	Pass
50C 120V	a	5240	Ant1	5240	0	0	25	Pass
20C 102V	a	5745	Ant1	5745	0	0	25	Pass
20C 120V	a	5745	Ant1	5745	0	0	25	Pass
20C 138V	a	5745	Ant1	5745	0	0	25	Pass
-20C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	a	5745	Ant1	5745	0	0	25	Pass
0C 120V	a	5745	Ant1	5745	0	0	25	Pass
10C 120V	a	5745	Ant1	5745	0	0	25	Pass
30C 120V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
40C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 120V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 102V	a	5825	Ant1	5825	0	0	25	Pass
20C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 138V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	a	5825	Ant1	5825	0	0	25	Pass
0C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass


30C 120V	a	5825	Ant1	5825	0	0	25	Pass
40C 120V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
50C 120V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 120V	n20	5180	Ant1	5180	0	0	25	Pass
20C 138V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
0C 120V	n20	5180	Ant1	5180	0	0	25	Pass
10C 120V	n20	5180	Ant1	5180	0	0	25	Pass
30C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 120V	n20	5180	Ant1	5180	0	0	25	Pass
50C 120V	n20	5180	Ant1	5180	0	0	25	Pass
20C 102V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	n20	5240	Ant1	5240	0	0	25	Pass
20C 138V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
-20C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	n20	5240	Ant1	5240	0	0	25	Pass
0C 120V	n20	5240	Ant1	5240	0	0	25	Pass
10C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
30C 120V	n20	5240	Ant1	5240	0	0	25	Pass
40C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
50C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	n20	5745	Ant1	5745	0	0	25	Pass
20C 120V	n20	5745	Ant1	5745	0	0	25	Pass
20C 138V	n20	5745	Ant1	5745	0	0	25	Pass
-20C 120V	n20	5745	Ant1	5745	0	0	25	Pass
-10C 120V	n20	5745	Ant1	5745	0	0	25	Pass
0C 120V	n20	5745	Ant1	5745	0	0	25	Pass
10C 120V	n20	5745	Ant1	5745	0	0	25	Pass
30C 120V	n20	5745	Ant1	5745	0	0	25	Pass
40C 120V	n20	5745	Ant1	5745	0	0	25	Pass
50C 120V	n20	5745	Ant1	5745	0	0	25	Pass
20C 102V	n20	5825	Ant1	5825	0	0	25	Pass
20C 120V	n20	5825	Ant1	5825	0	0	25	Pass
20C 138V	n20	5825	Ant1	5825	0	0	25	Pass
-20C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 120V	n20	5825	Ant1	5825	0	0	25	Pass
10C 120V	n20	5825	Ant1	5825	0	0	25	Pass
30C 120V	n20	5825	Ant1	5825	0	0	25	Pass


40C 120V	n20	5825	Ant1	5825	0	0	25	Pass
50C 120V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 102V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	n40	5190	Ant1	5190	0	0	25	Pass
-20C 120V	n40	5190	Ant1	5190	0	0	25	Pass
-10C 120V	n40	5190	Ant1	5190	0	0	25	Pass
0C 120V	n40	5190	Ant1	5190	0	0	25	Pass
10C 120V	n40	5190	Ant1	5190	0	0	25	Pass
30C 120V	n40	5190	Ant1	5190	0	0	25	Pass
40C 120V	n40	5190	Ant1	5190	0	0	25	Pass
50C 120V	n40	5190	Ant1	5190	0	0	25	Pass
20C 102V	n40	5230	Ant1	5230	0	0	25	Pass
20C 120V	n40	5230	Ant1	5230	0	0	25	Pass
20C 138V	n40	5230	Ant1	5230	0	0	25	Pass
-20C 120V	n40	5230	Ant1	5230	0	0	25	Pass
-10C 120V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
0C 120V	n40	5230	Ant1	5230	0	0	25	Pass
10C 120V	n40	5230	Ant1	5230	0	0	25	Pass
30C 120V	n40	5230	Ant1	5230	0	0	25	Pass
40C 120V	n40	5230	Ant1	5230	0	0	25	Pass
50C 120V	n40	5230	Ant1	5230	0	0	25	Pass
20C 102V	n40	5755	Ant1	5755	0	0	25	Pass
20C 120V	n40	5755	Ant1	5755	0	0	25	Pass
20C 138V	n40	5755	Ant1	5755	0	0	25	Pass
-20C 120V	n40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
0C 120V	n40	5755	Ant1	5755	0	0	25	Pass
10C 120V	n40	5755	Ant1	5755	0	0	25	Pass
30C 120V	n40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
40C 120V	n40	5755	Ant1	5755	0	0	25	Pass
50C 120V	n40	5755	Ant1	5755	0	0	25	Pass
20C 102V	n40	5795	Ant1	5795	0	0	25	Pass
20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 138V	n40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	n40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
0C 120V	n40	5795	Ant1	5795	0	0	25	Pass
10C 120V	n40	5795	Ant1	5795	0	0	25	Pass
30C 120V	n40	5795	Ant1	5795	0	0	25	Pass
40C 120V	n40	5795	Ant1	5795	0	0	25	Pass

50C 120V	n40	5795	Ant1	5795	0	0	25	Pass
20C 102V	ac20	5180	Ant1	5180	0	0	25	Pass
20C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
20C 138V	ac20	5180	Ant1	5180	0	0	25	Pass
-20C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
-10C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
0C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
10C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
30C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
40C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
50C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
20C 102V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 138V	ac20	5240	Ant1	5240	0	0	25	Pass
-20C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
0C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
10C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
30C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
40C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
50C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 102V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 138V	ac20	5745	Ant1	5745	0	0	25	Pass
-20C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 120V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
0C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
30C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
40C 120V	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 102V	ac20	5825	Ant1	5825	0	0	25	Pass
20C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
20C 138V	ac20	5825	Ant1	5825	0	0	25	Pass
-20C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
-10C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
0C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 120V	ac20	5825	Ant1	5825	0	0	25	Pass
30C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 120V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 120V	ac20	5825	Ant1	5825	0	0	25	Pass


20C 102V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
20C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 138V	ac40	5190	Ant1	5190	0	0	25	Pass
-20C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
-10C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
0C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
10C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
30C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
40C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
50C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 102V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 138V	ac40	5230	Ant1	5230	0	0	25	Pass
-20C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
-10C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
0C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
10C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
30C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
40C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
50C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 102V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 138V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-20C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
-10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
0C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
10C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
30C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
40C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
50C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
20C 102V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 138V	ac40	5795	Ant1	5795	0	0	25	Pass
-20C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
-10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
0C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
10C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
30C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
40C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
50C 120V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 102V	ac80	5210	Ant1	5210	0	0	25	Pass

20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 138V	ac80	5210	Ant1	5210	0	0	25	Pass
-20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
-10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
0C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
30C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
40C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
50C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 102V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 138V	ac80	5775	Ant1	5775	0	0	25	Pass
-20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
-10C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
0C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
10C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
30C 120V	ac80	5775	Ant1	5774.92	-80000	-13.85	25	Pass
40C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
50C 120V	ac80	5775	Ant1	5775	0	0	25	Pass

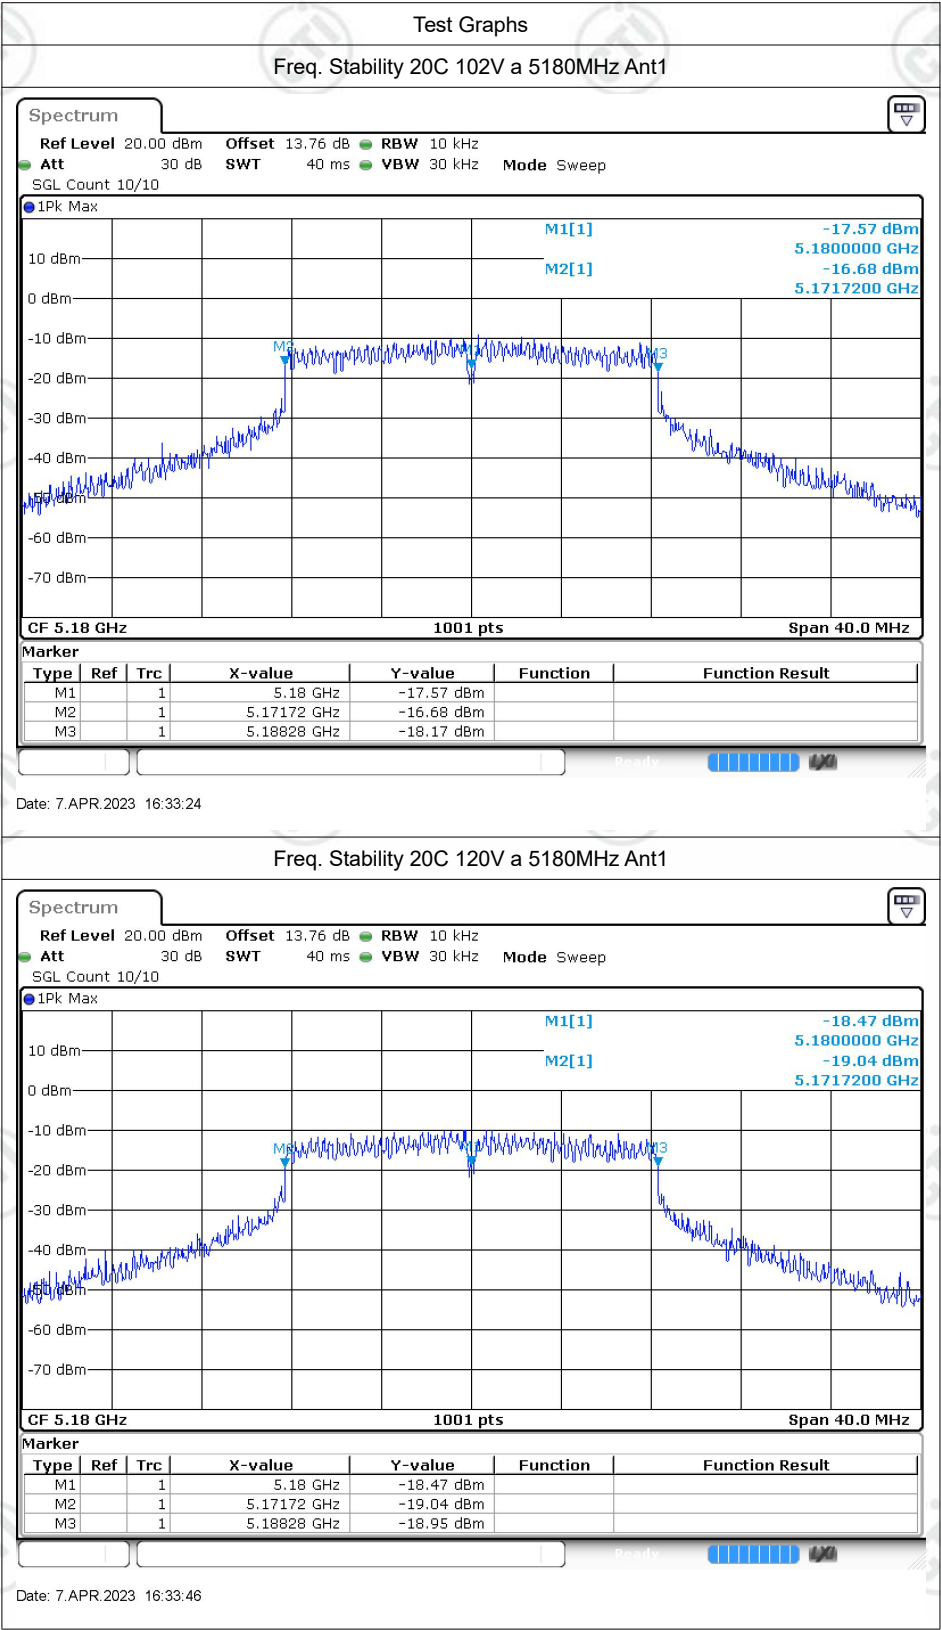


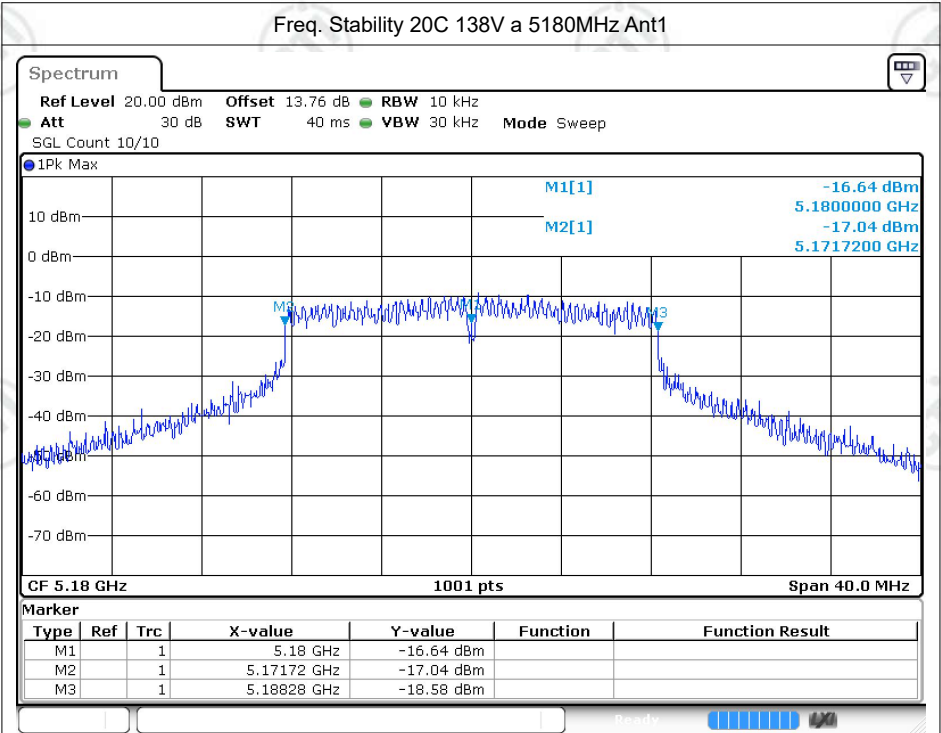


Date: 7.APR.2023 16:33:31

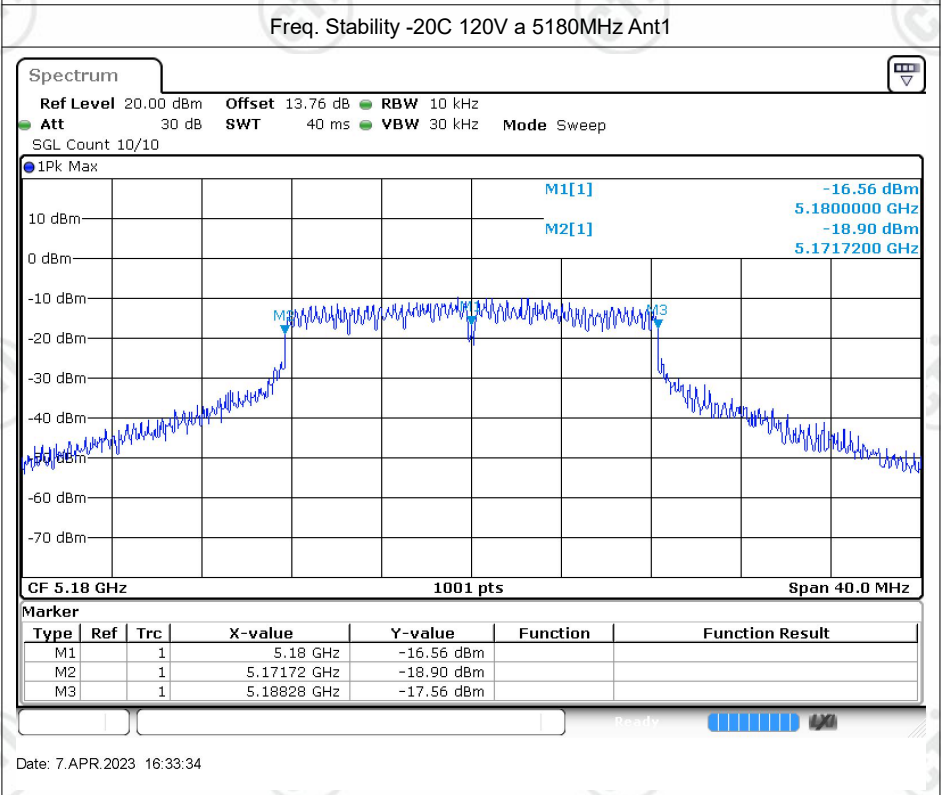


Date: 7.APR.2023 16:33:34

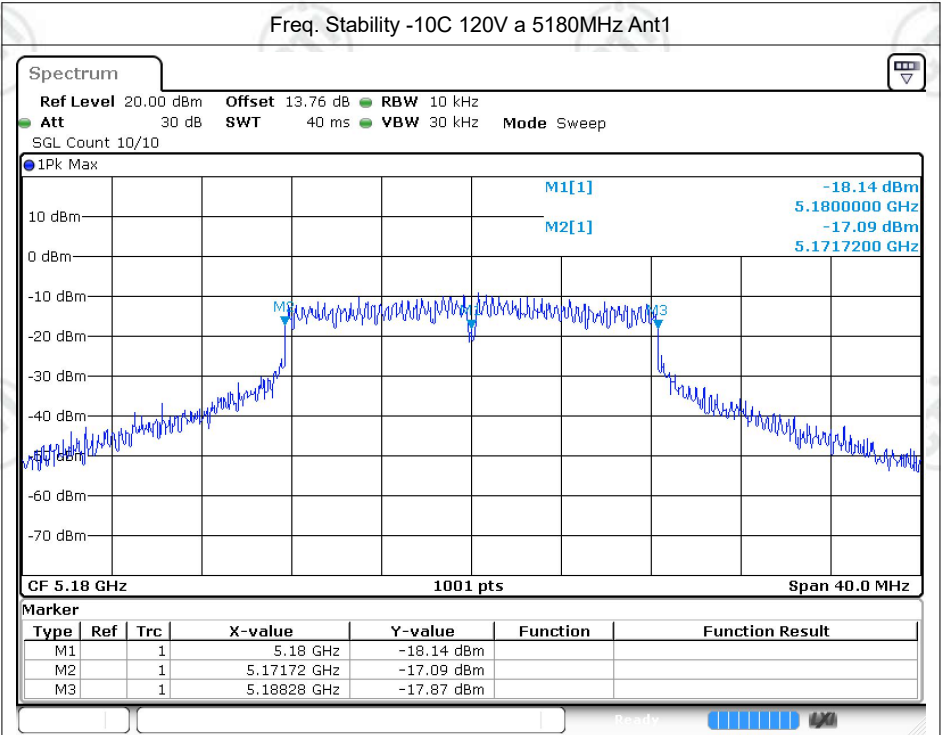


Date: 7.APR.2023 16:33:37

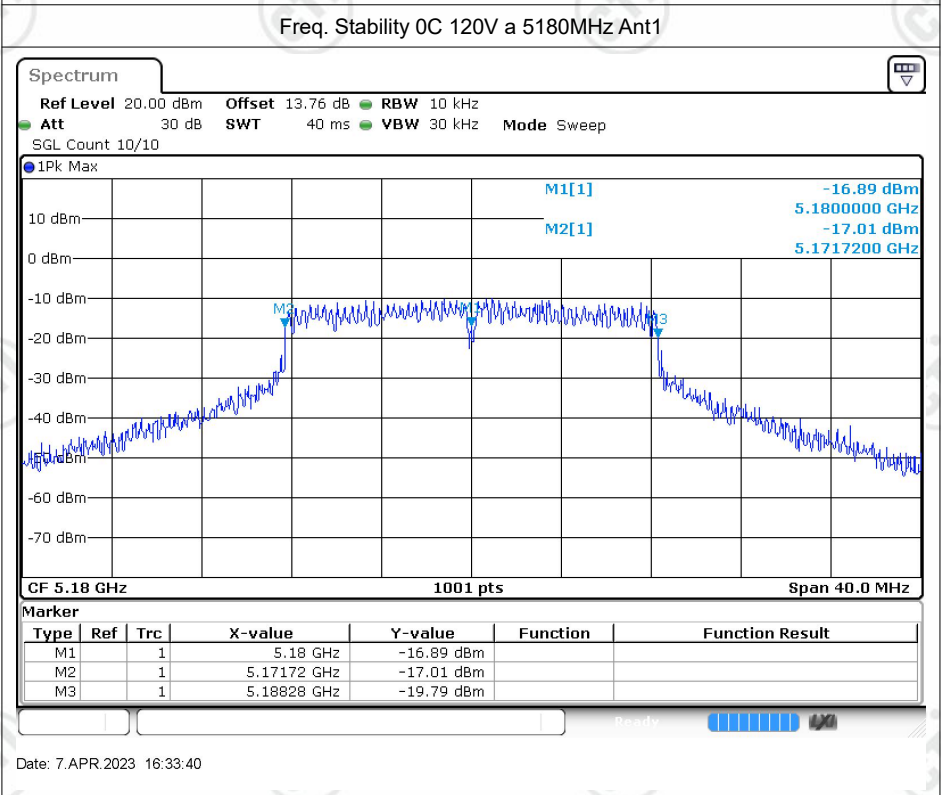


Date: 7.APR.2023 16:33:40

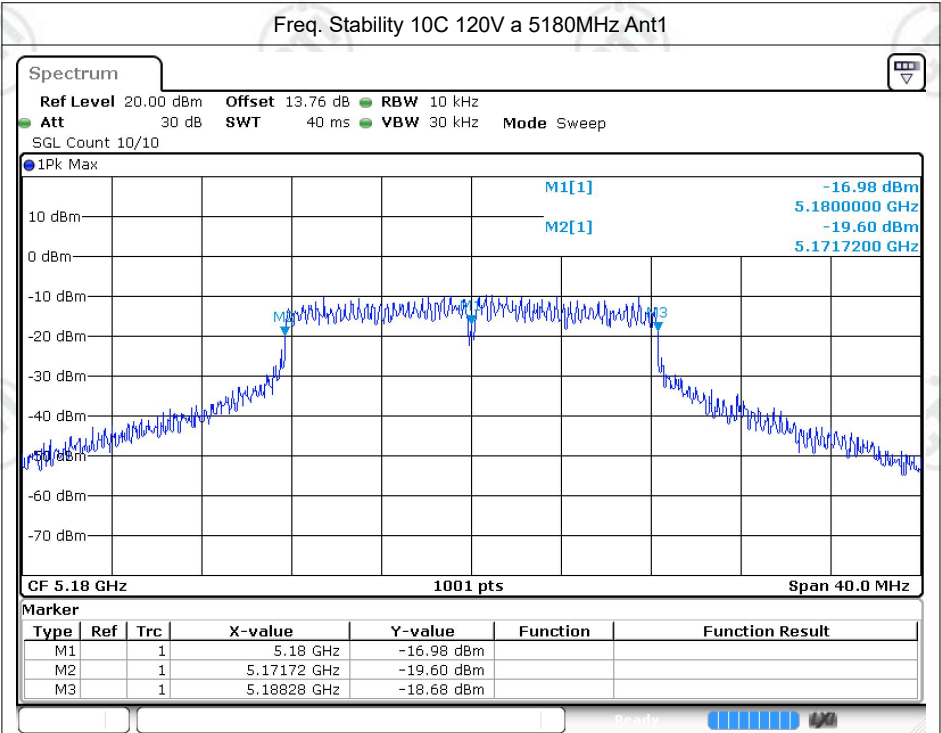


Date: 7.APR.2023 16:33:43

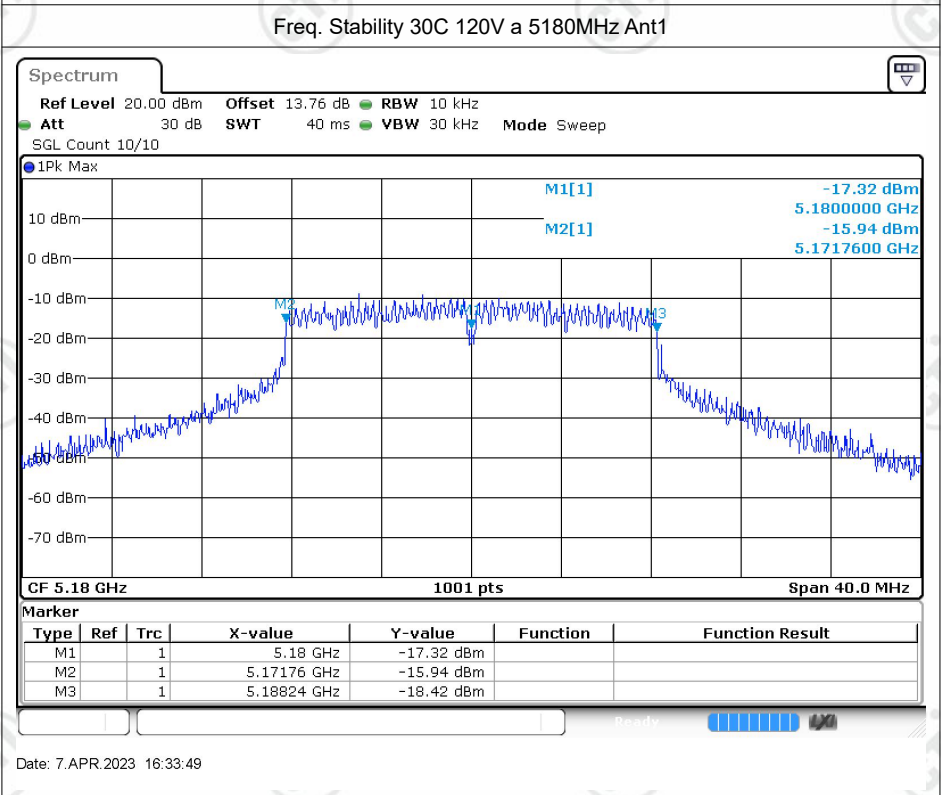


Date: 7.APR.2023 16:33:49

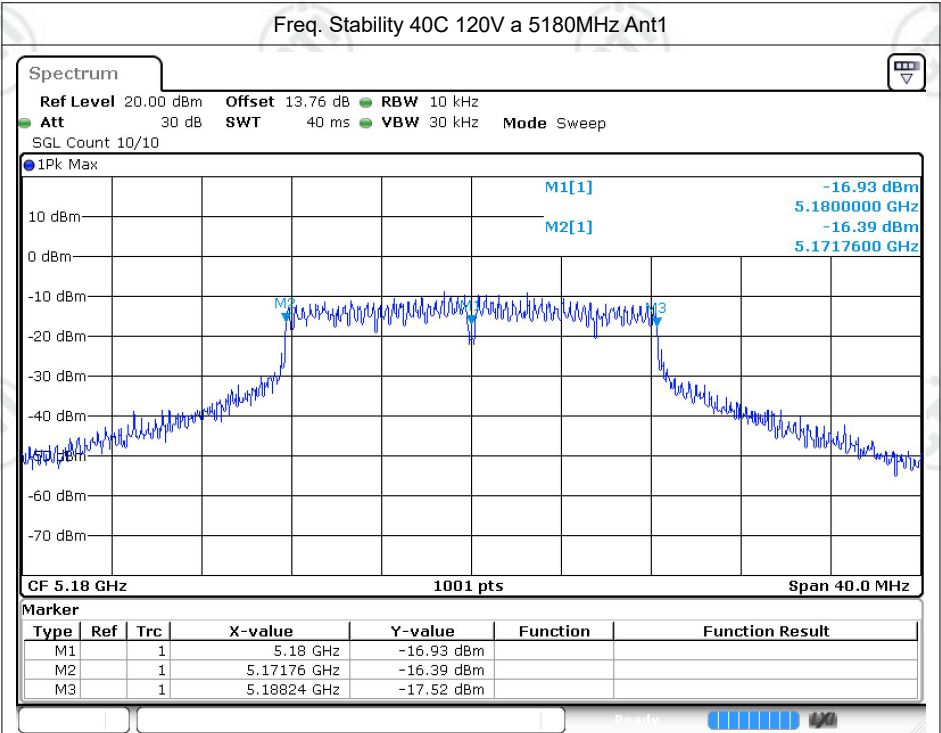


Date: 7.APR.2023 16:33:52

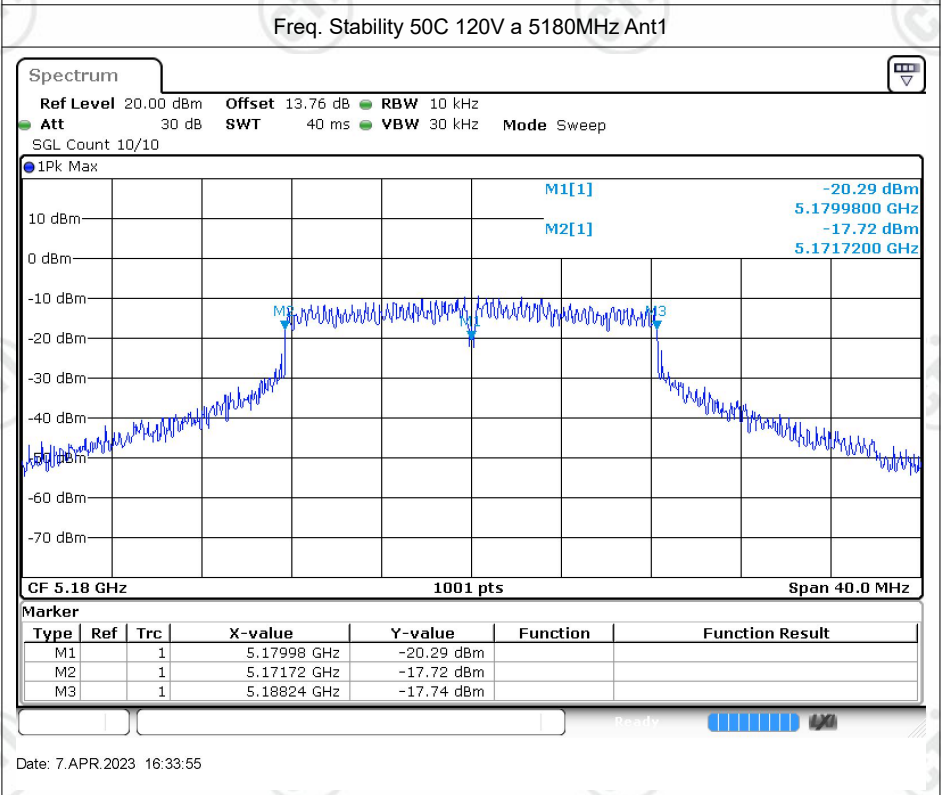


Date: 7.APR.2023 16:33:55

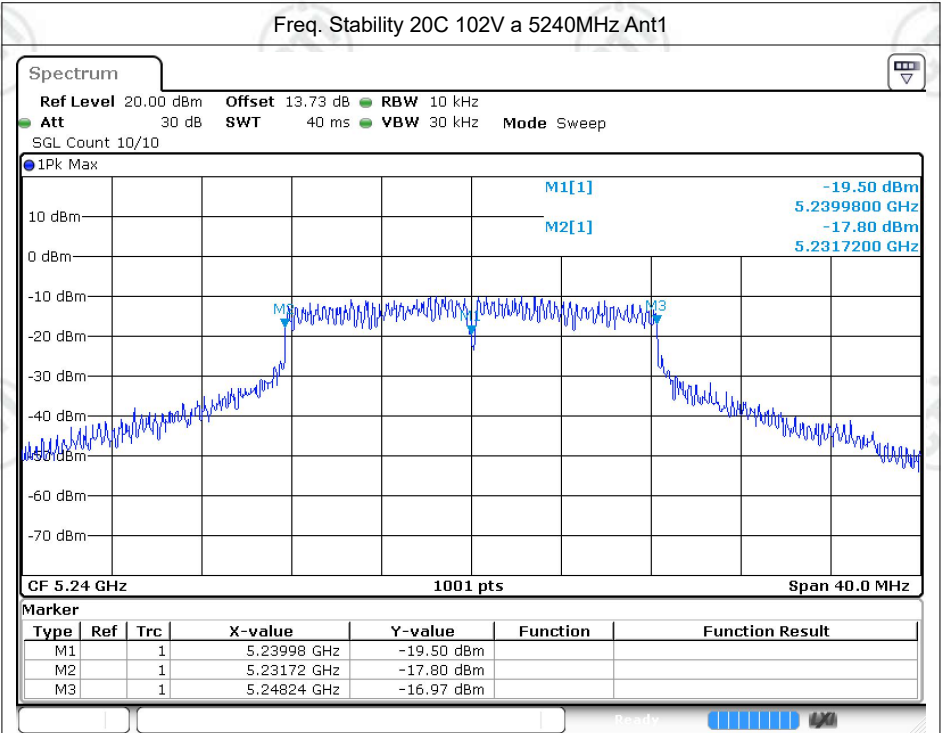


Date: 7.APR.2023 16:40:05

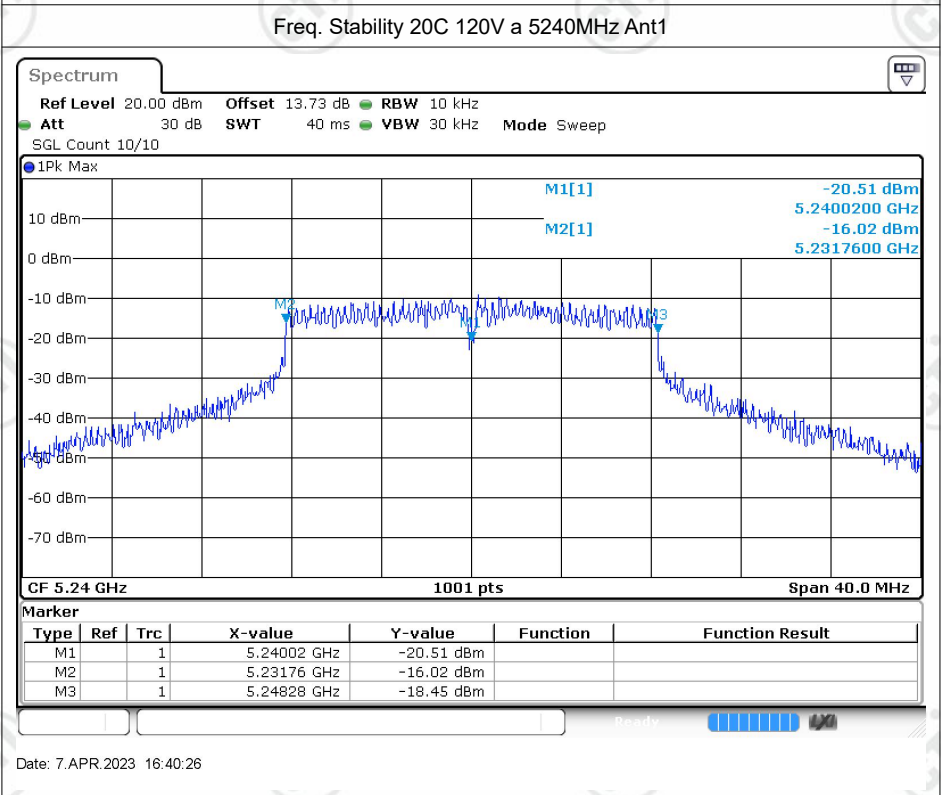


Date: 7.APR.2023 16:40:26

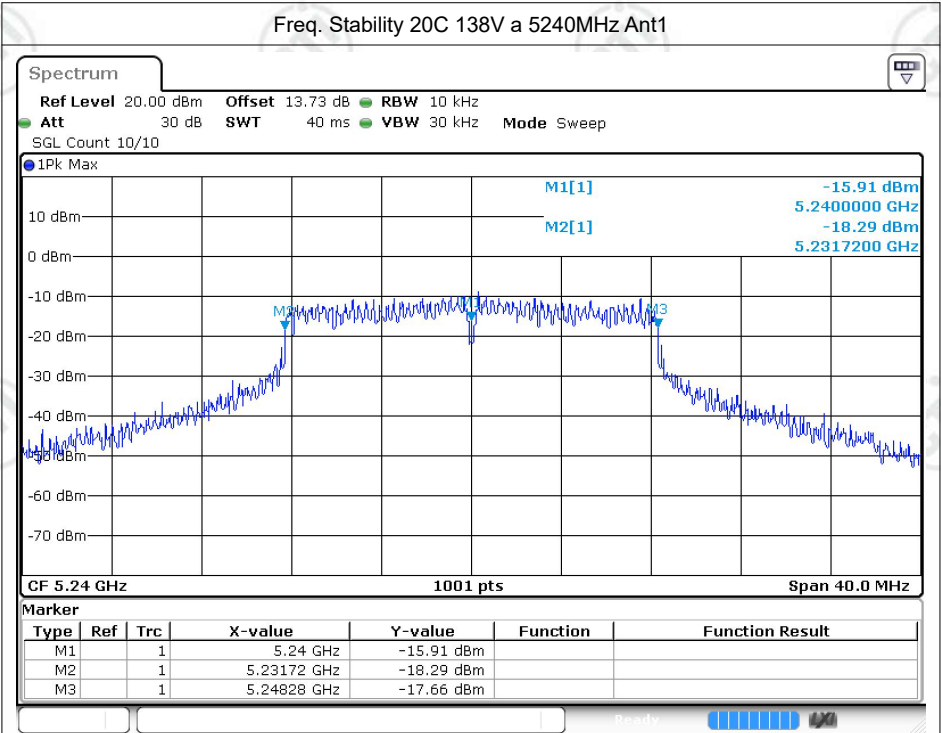


Date: 7.APR.2023 16:40:11

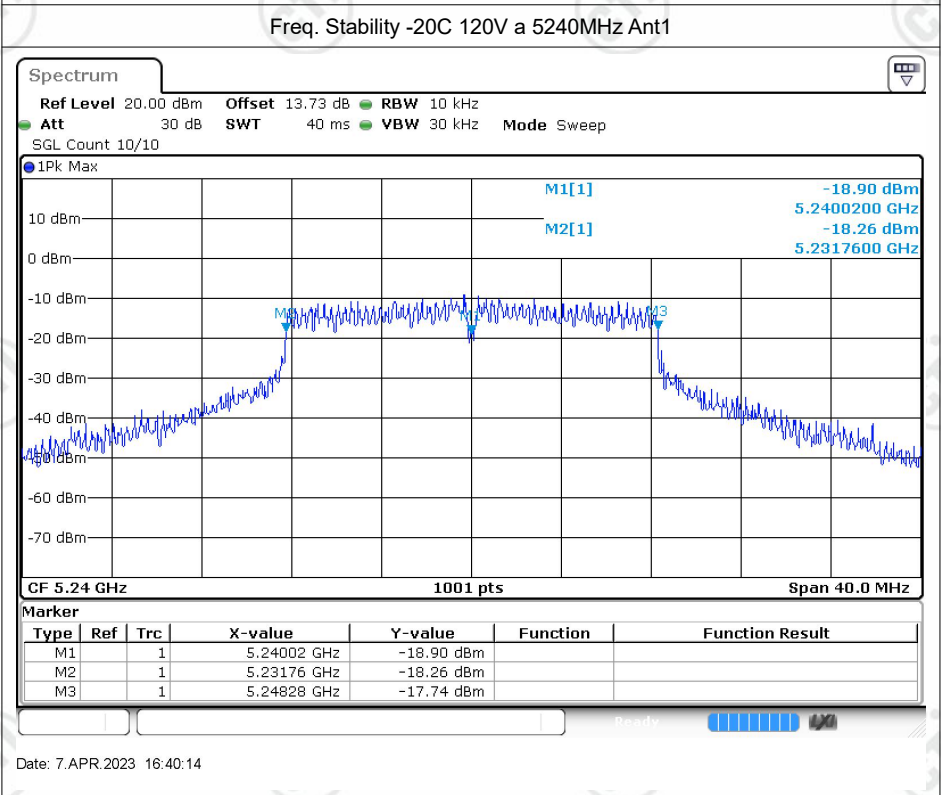


Date: 7.APR.2023 16:40:14

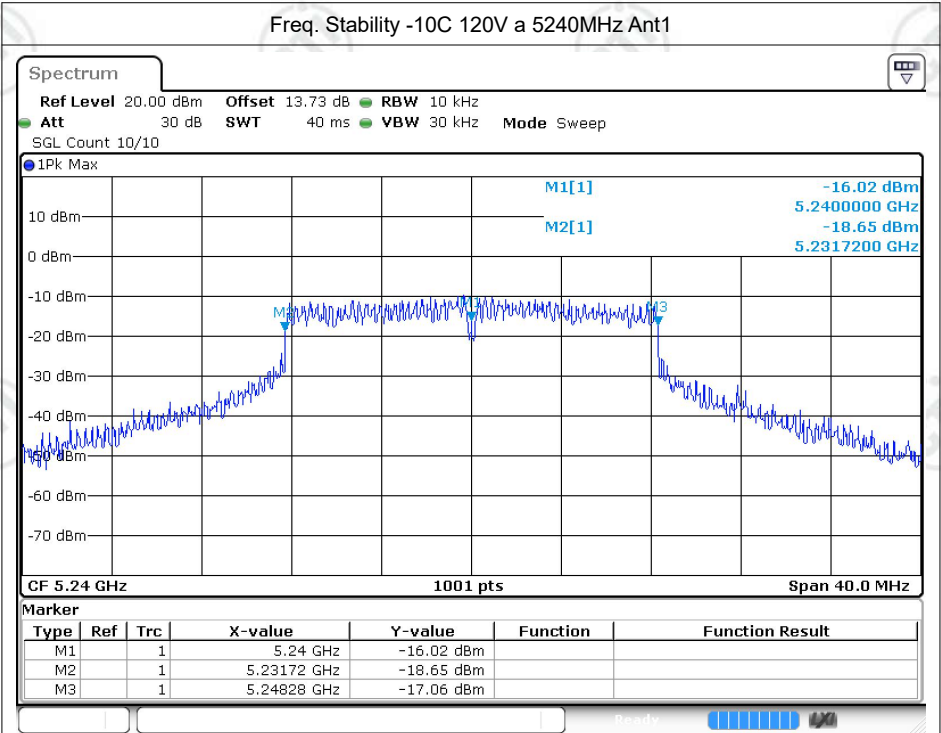


Date: 7.APR.2023 16:40:17

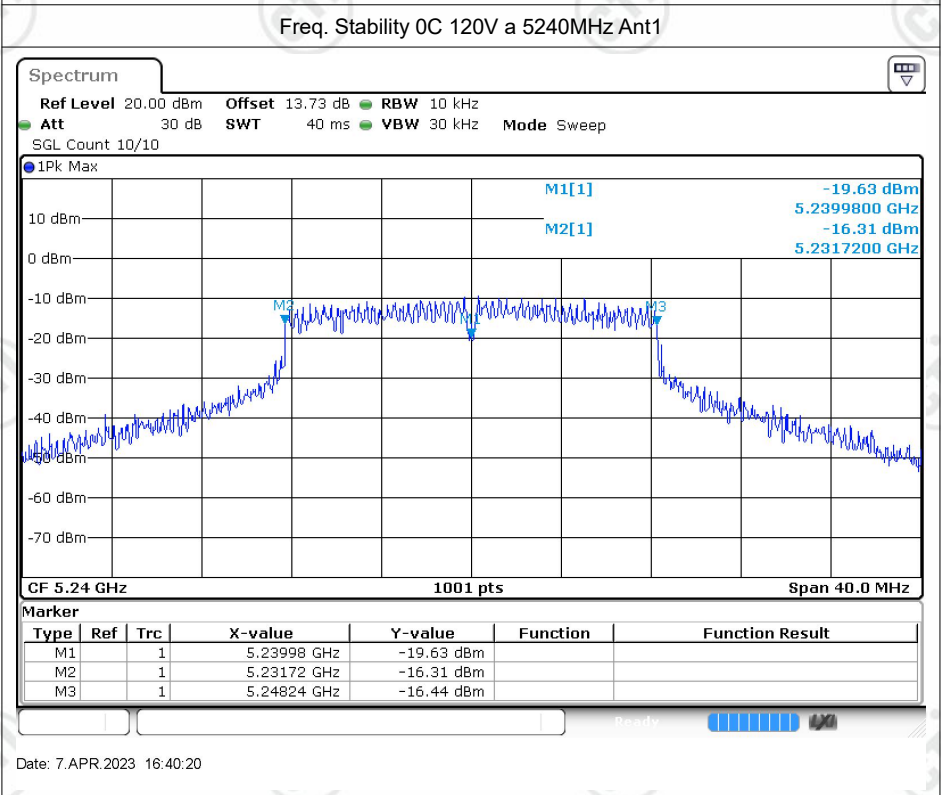


Date: 7.APR.2023 16:40:20

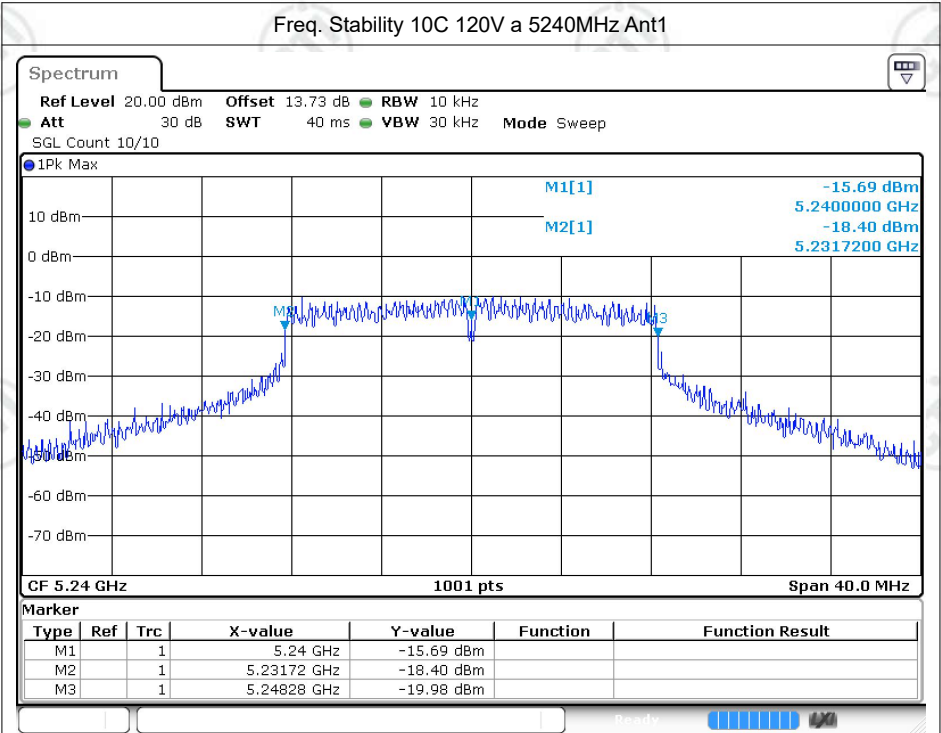


Date: 7.APR.2023 16:40:23

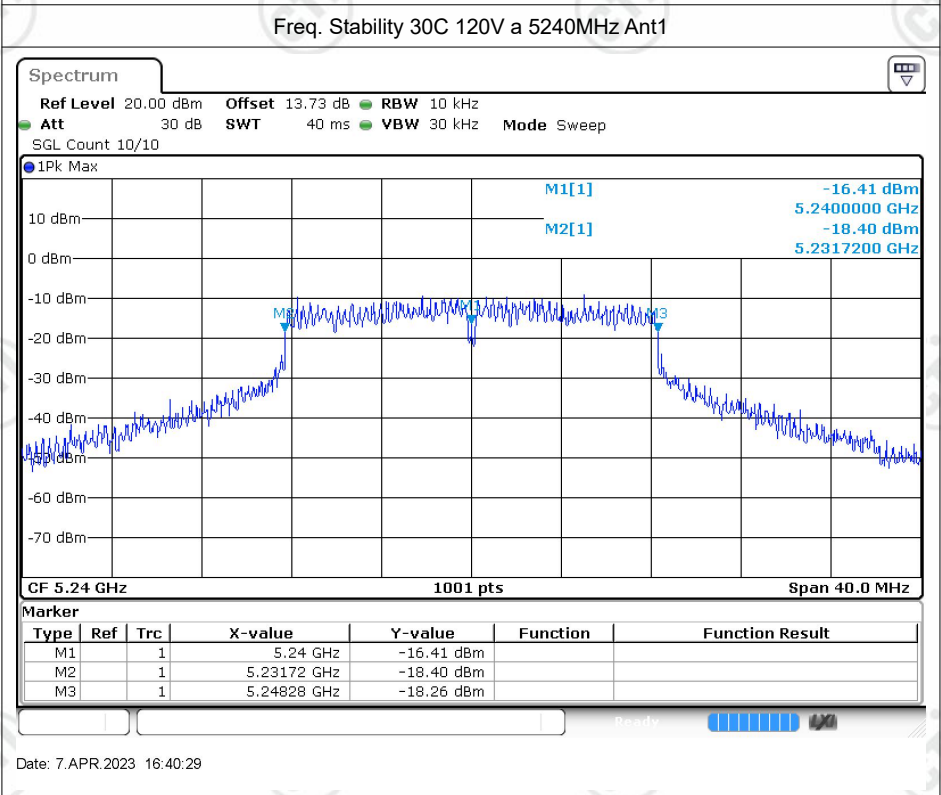


Date: 7.APR.2023 16:40:29

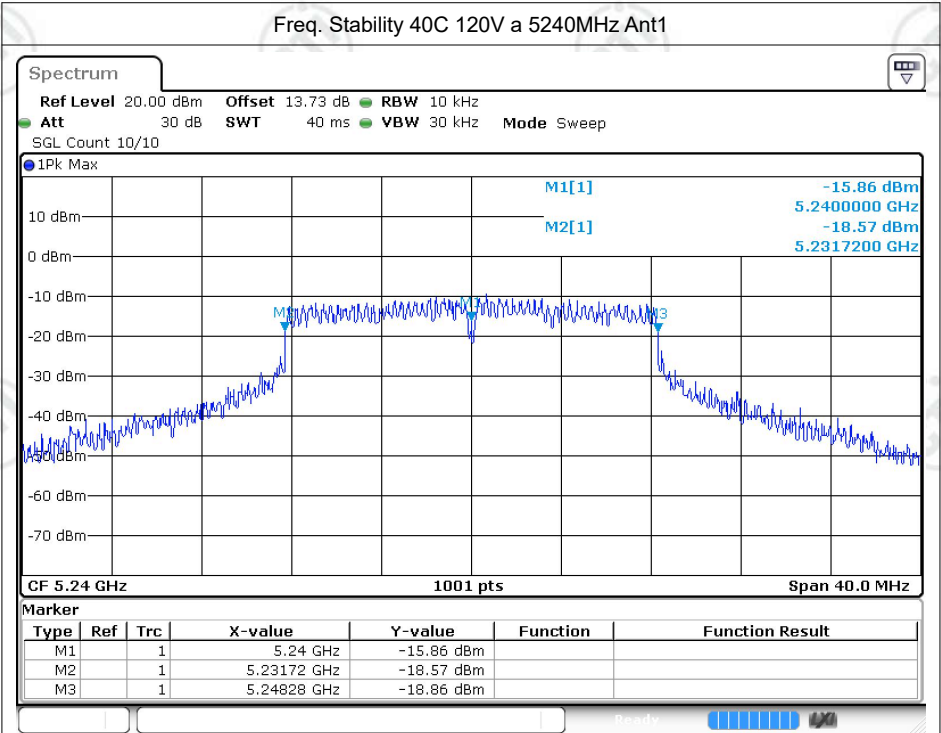


Date: 7.APR.2023 16:40:32

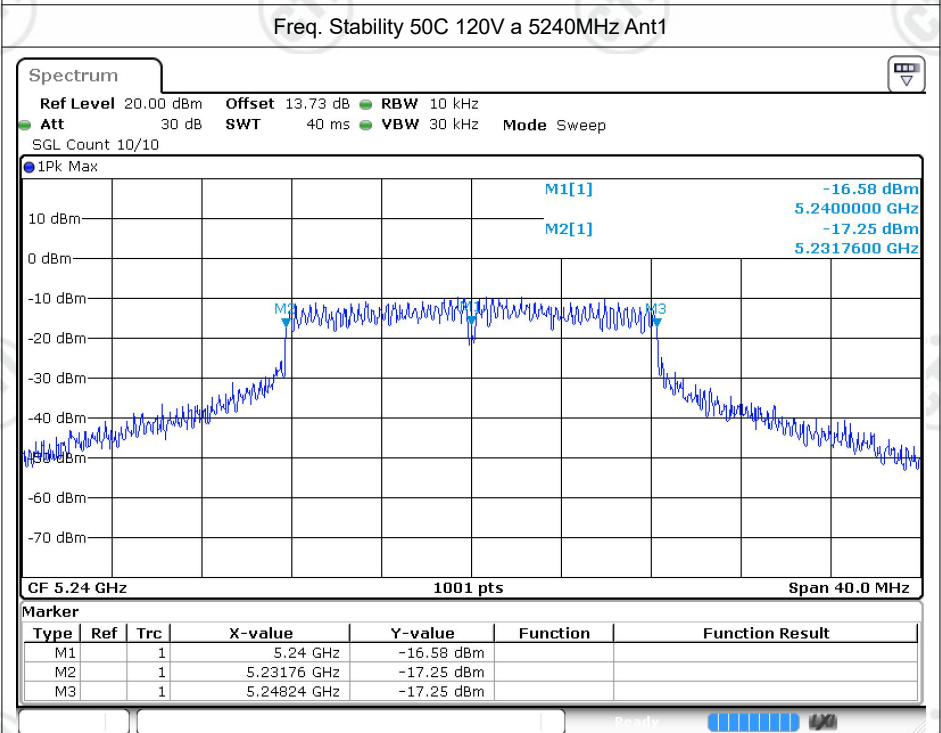

Date: 7.APR.2023 16:40:35

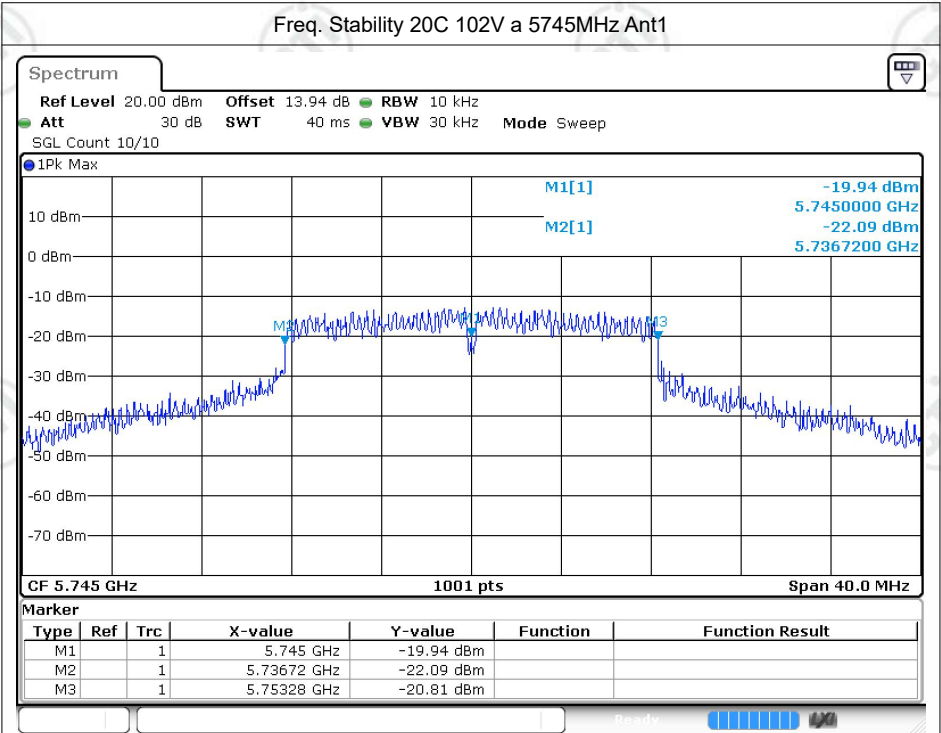

Date: 7.APR.2023 16:46:04

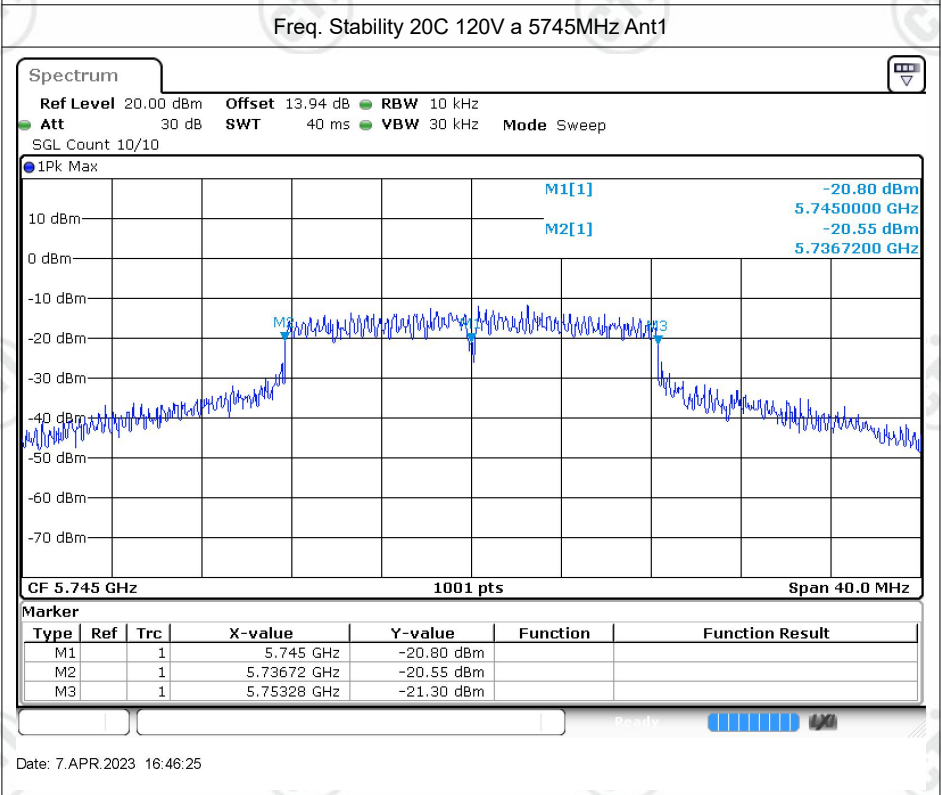

Date: 7.APR.2023 16:46:25