





PSD NVNT n20 5200MHz Ant1

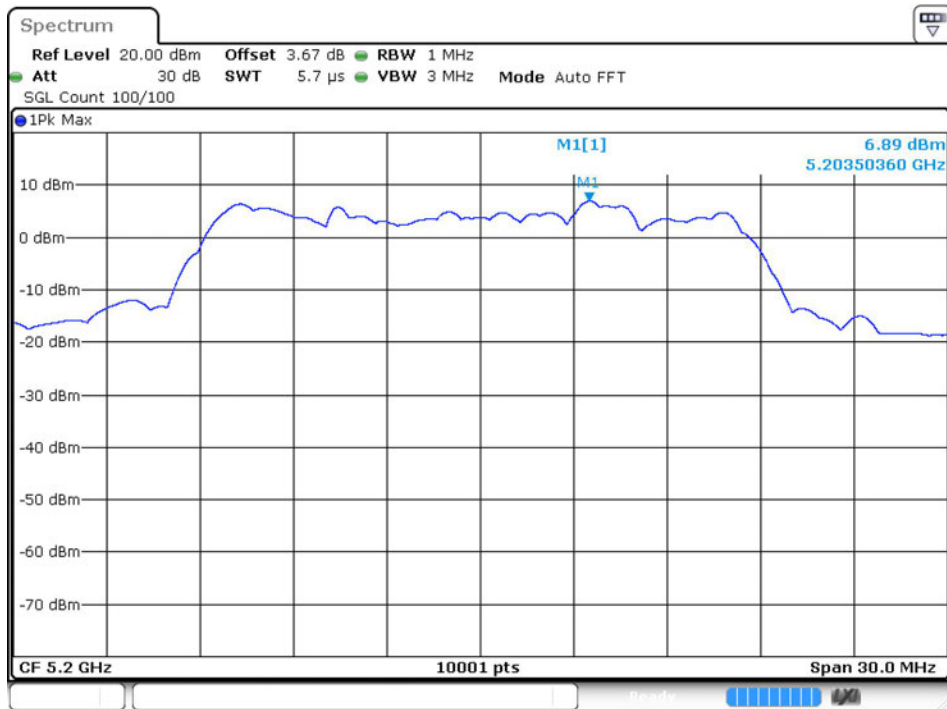


PSD NVNT n20 5240MHz Ant1

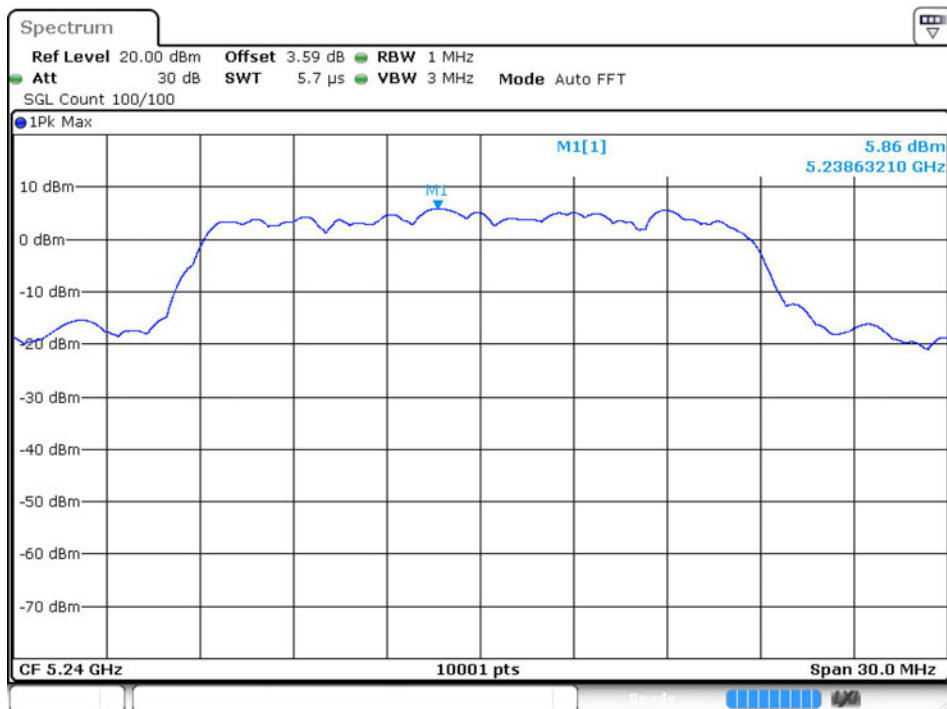




PSD NVNT n40 5190MHz Ant1

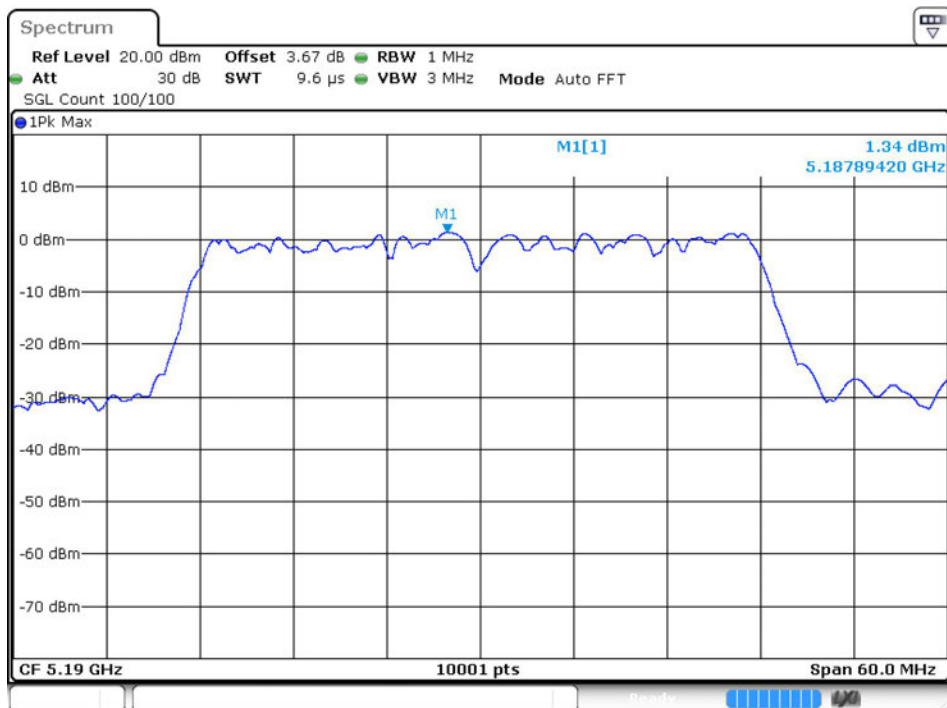


PSD NVNT n40 5230MHz Ant1

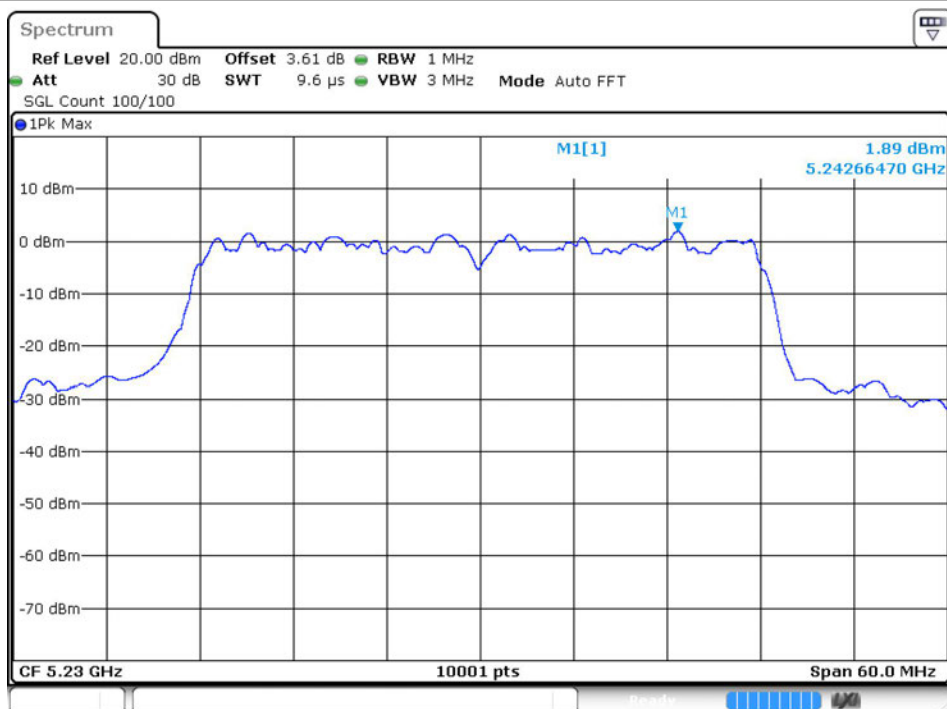




PSD NVNT ac20 5180MHz Ant1

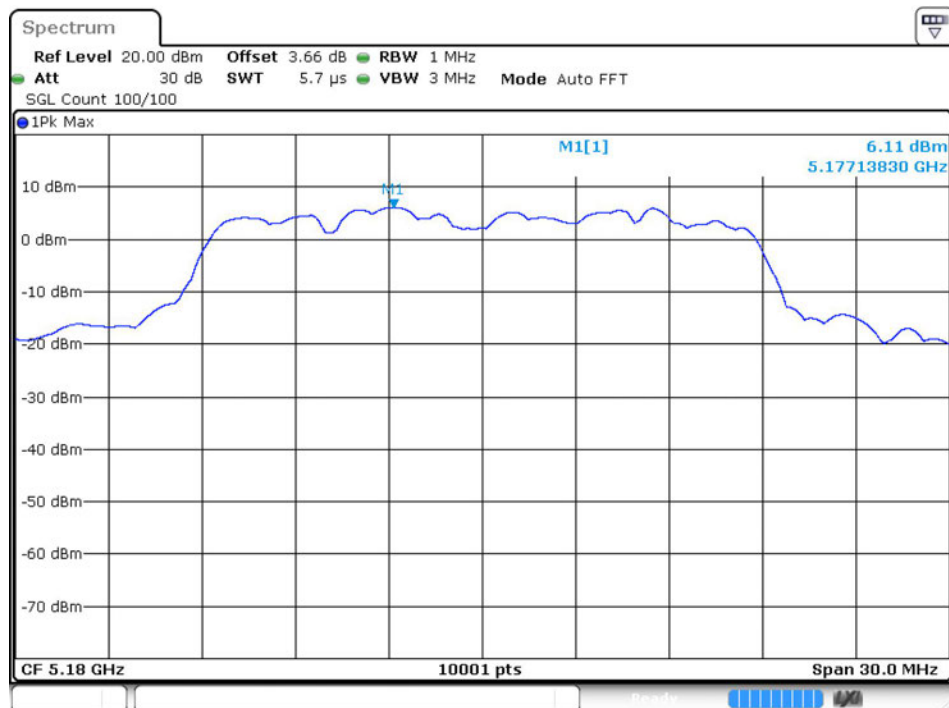


PSD NVNT ac20 5200MHz Ant1

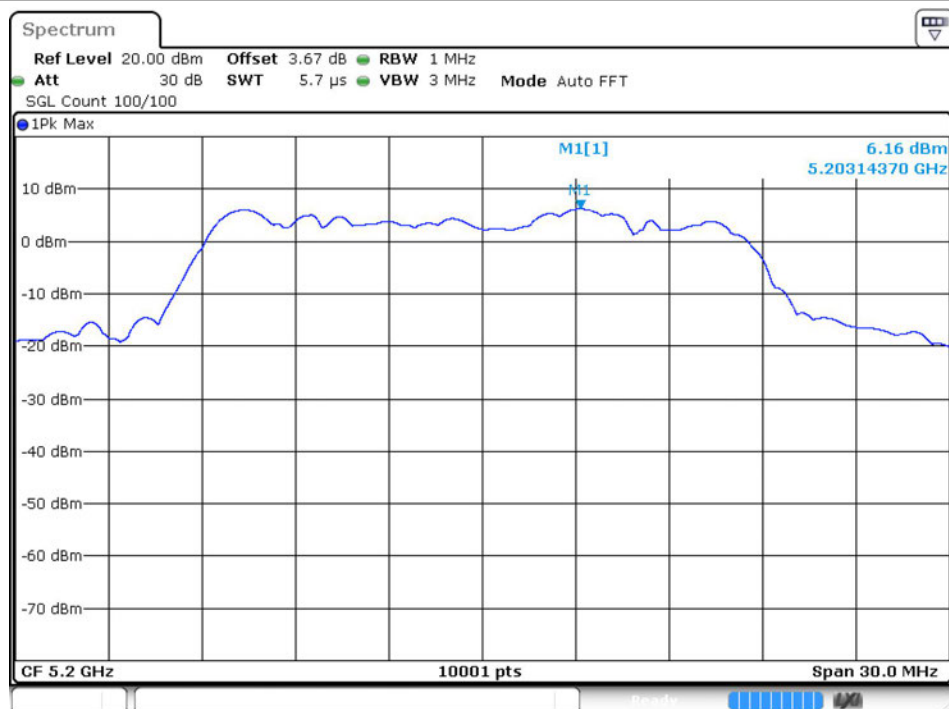




PSD NVNT ac20 5240MHz Ant1

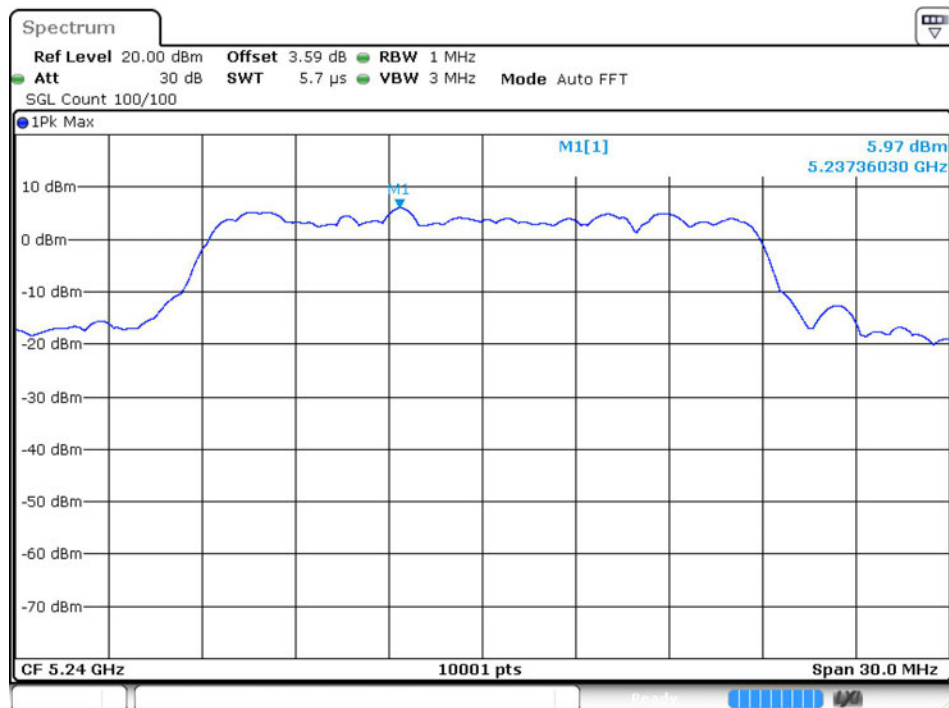


PSD NVNT ac40 5190MHz Ant1

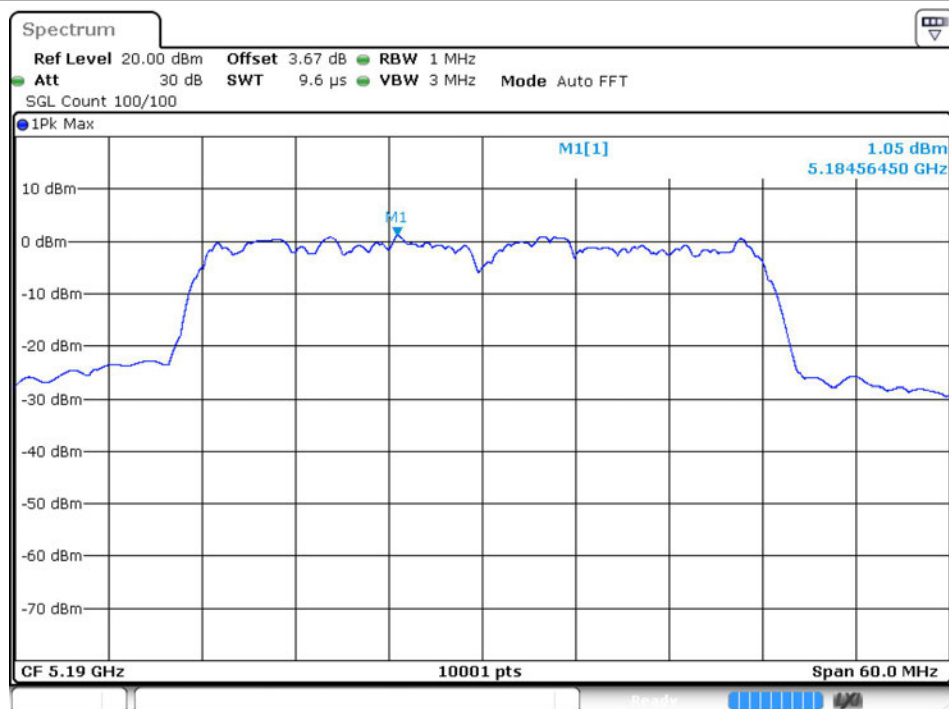




PSD NVNT ac40 5230MHz Ant1

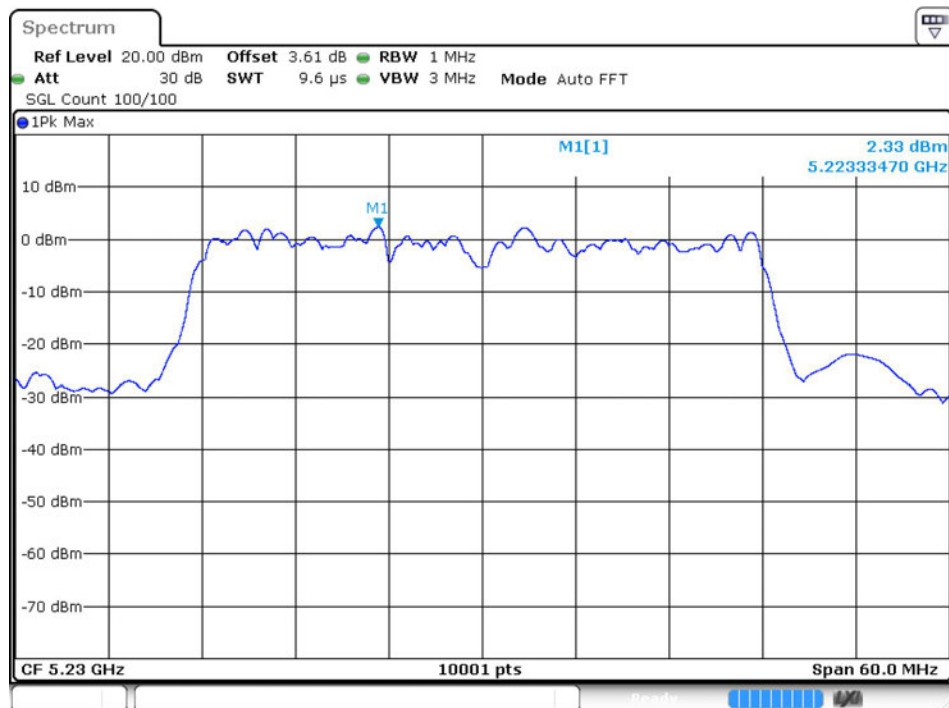

PSD NVNT ac80 5210MHz Ant1

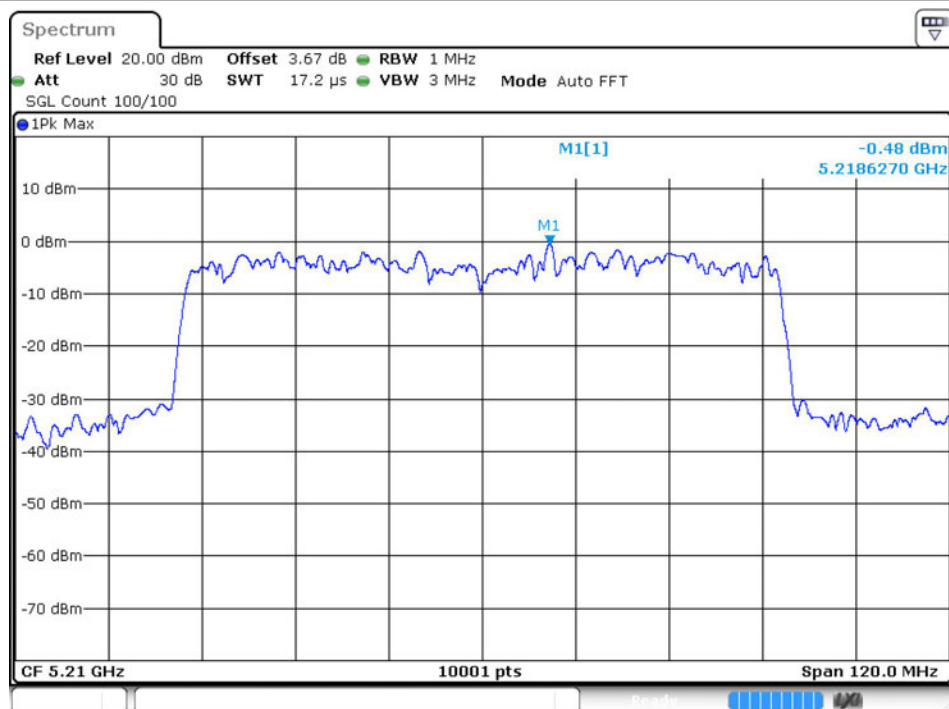



6 Band Edge

Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
802.11a	5180	Ant1	-34.06	-27	Pass
802.11a	5240	Ant1	-43.46	-27	Pass
802.11n20	5180	Ant1	-33.27	-27	Pass
802.11n20	5240	Ant1	-43.14	-27	Pass
802.11n40	5190	Ant1	-33.44	-27	Pass
802.11n40	5230	Ant1	-43.03	-27	Pass
802.11ac20	5180	Ant1	-32.4	-27	Pass
802.11ac20	5240	Ant1	-43.44	-27	Pass
802.11ac40	5190	Ant1	-35.01	-27	Pass
802.11ac40	5230	Ant1	-44.41	-27	Pass
802.11ac80	5210	Ant1	-35.48	-27	Pass




Test Graphs

Band Edge NVNT a 5180MHz Low Ant1




Band Edge NVNT a 5240MHz High Ant1

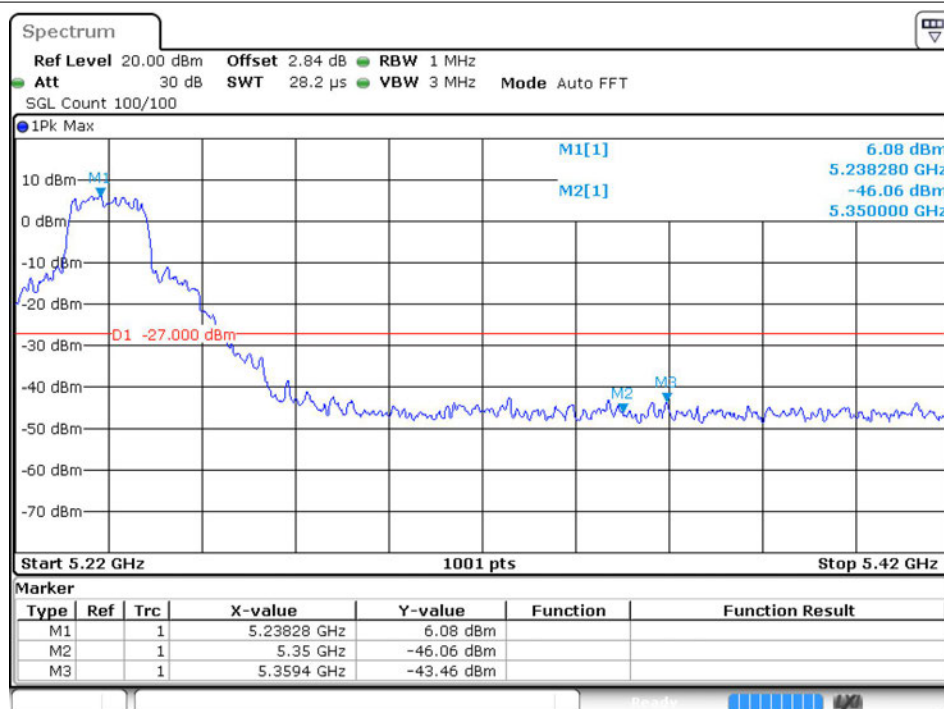




Band Edge NVNT n20 5180MHz Low Ant1

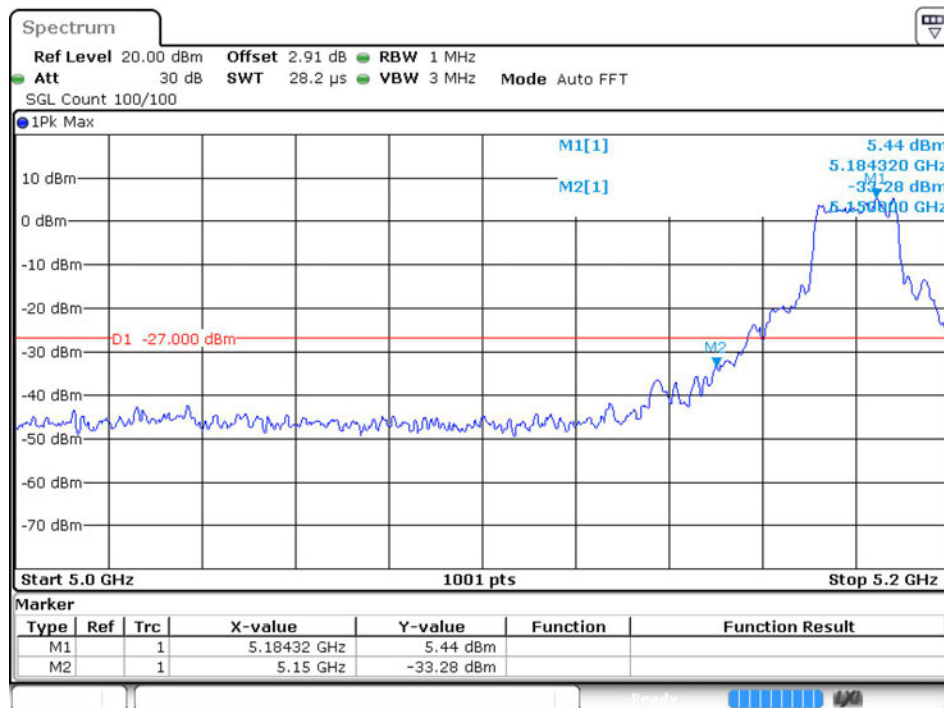


Band Edge NVNT n20 5240MHz High Ant1

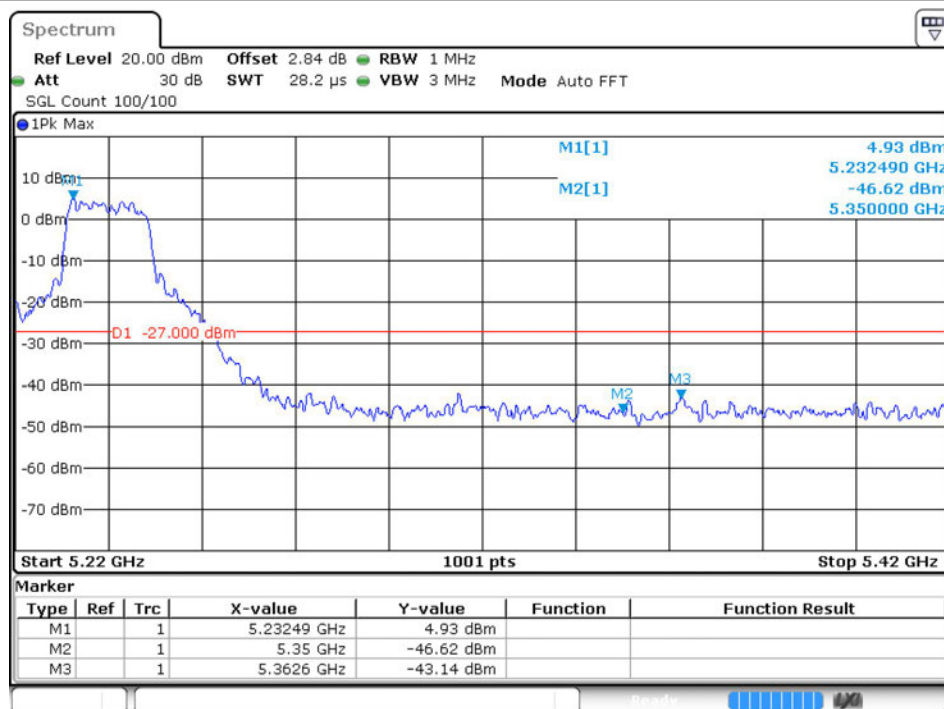



Band Edge NVNT n40 5190MHz Low Ant1

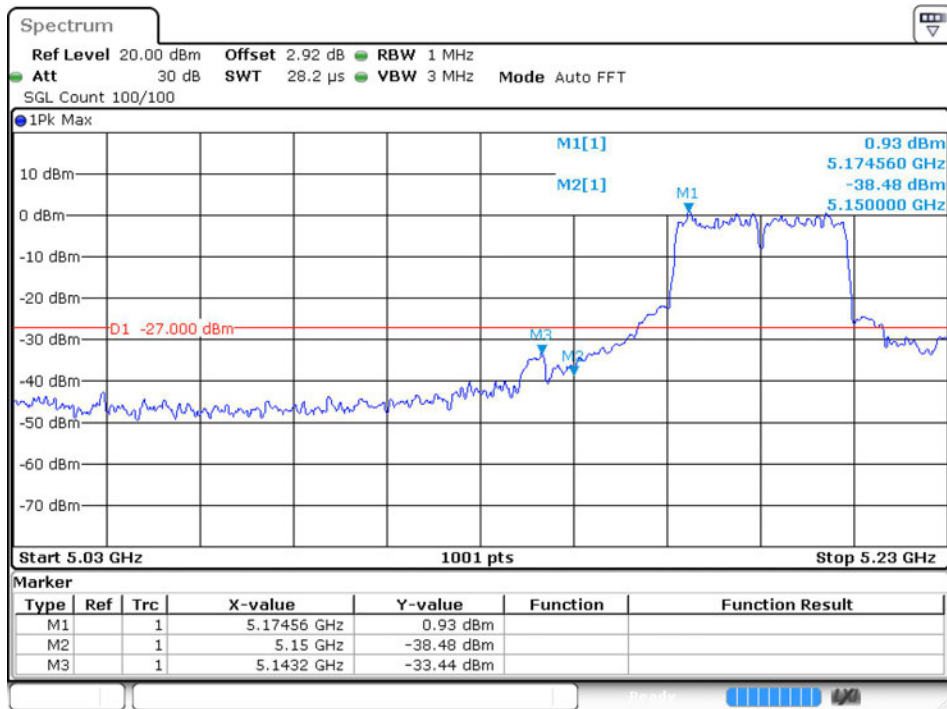


Band Edge NVNT n40 5230MHz High Ant1






Band Edge NVNT ac20 5180MHz Low Ant1

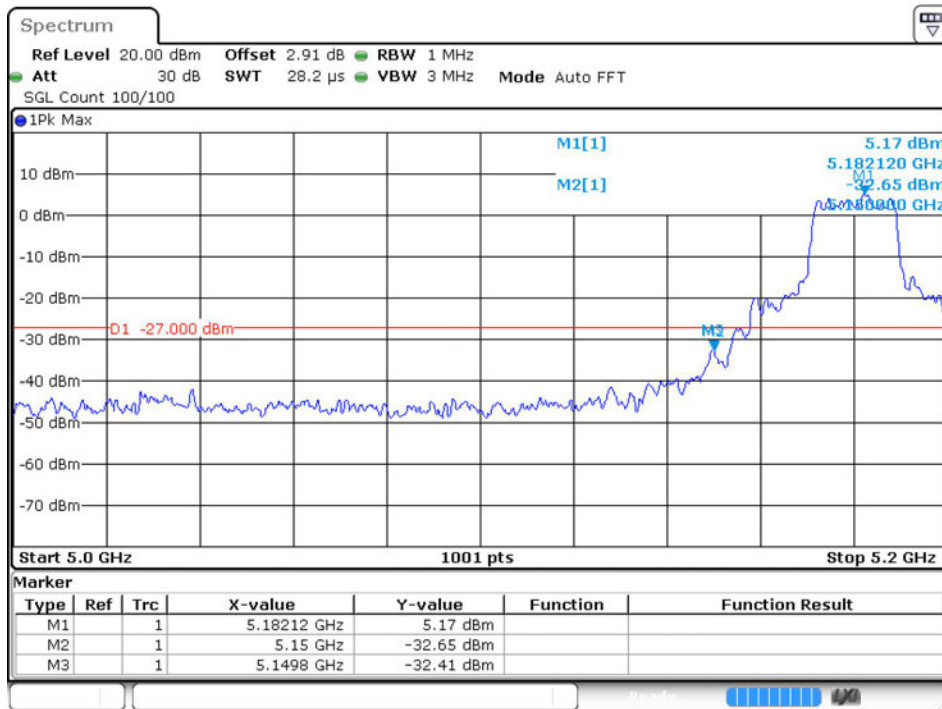


Band Edge NVNT ac20 5240MHz High Ant1

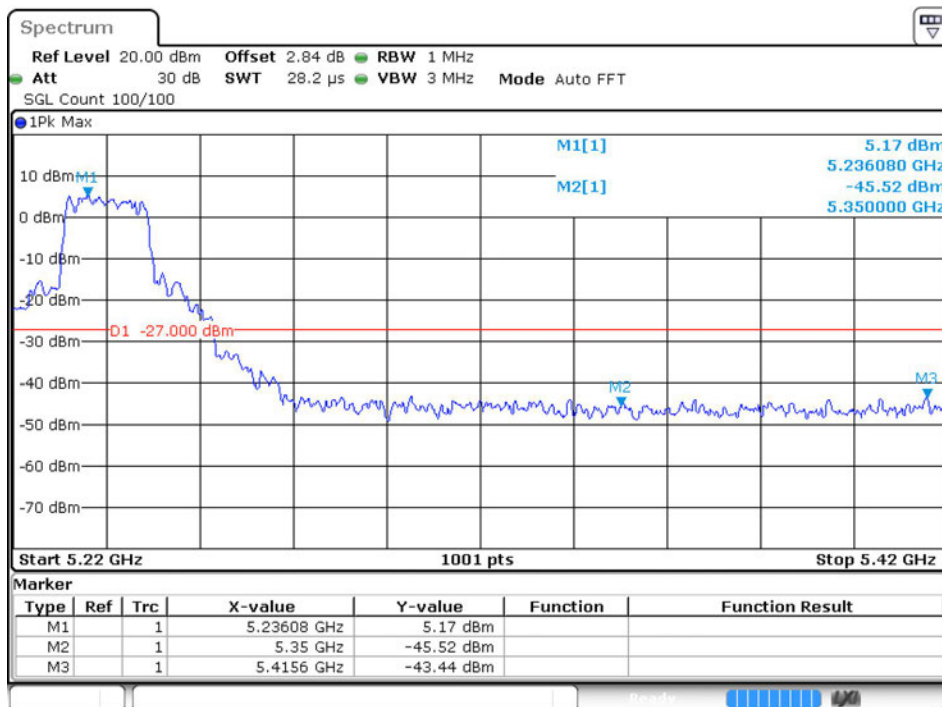




Band Edge NVNT ac40 5190MHz Low Ant1

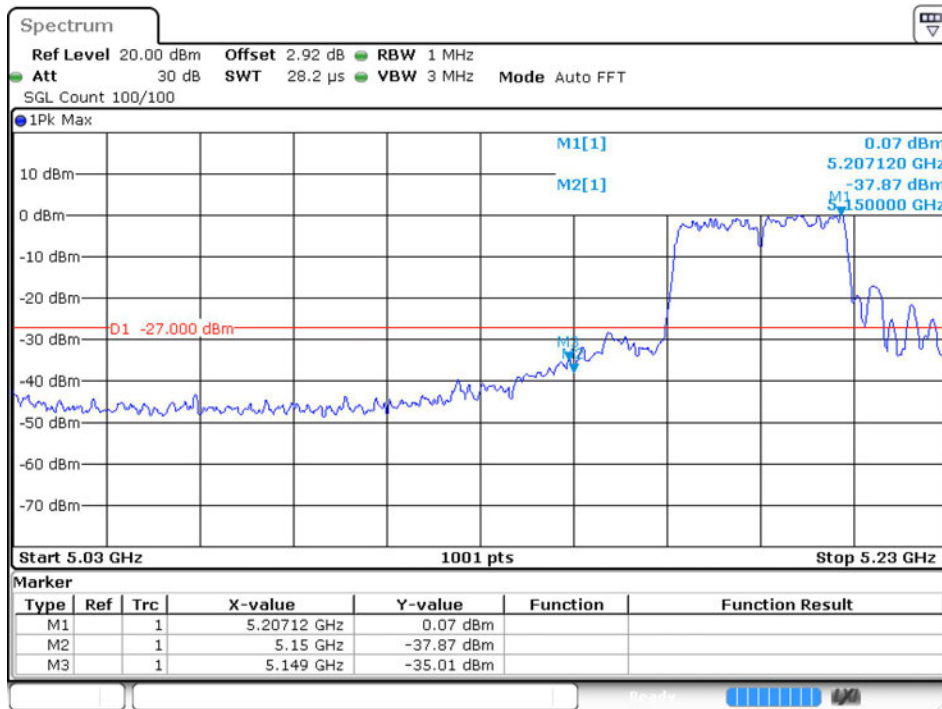

Band Edge NVNT ac40 5230MHz High Ant1



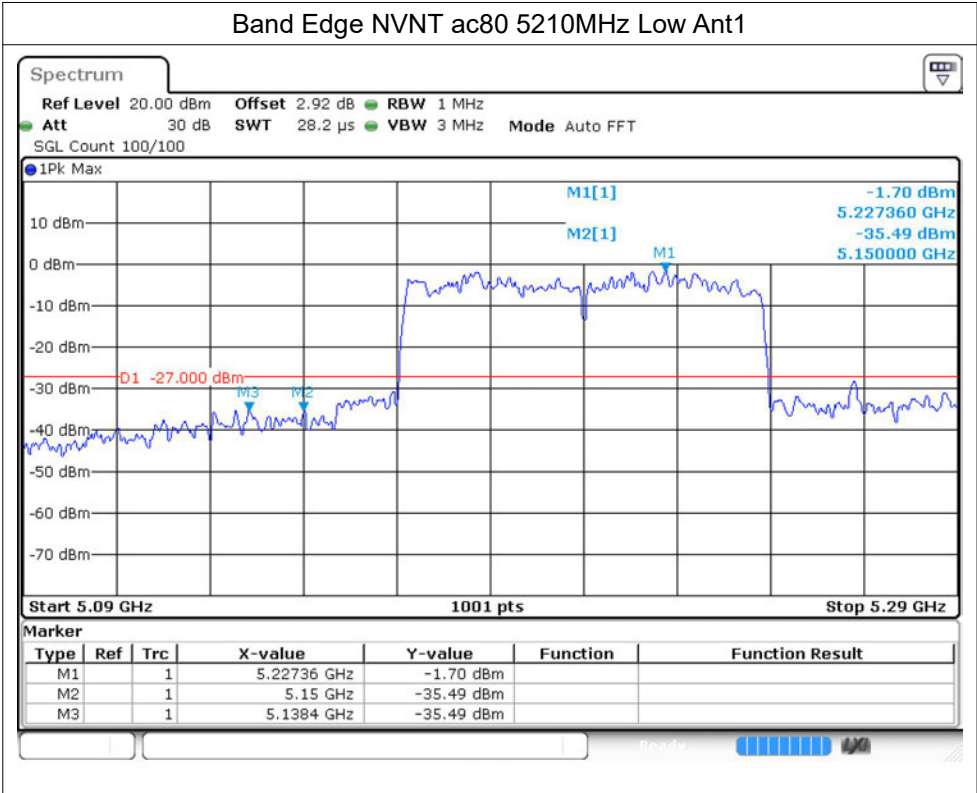



7 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 138V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-10C 120V	a	5180	Ant1	5180	0	0	25	Pass
0C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 120V	a	5180	Ant1	5179.96	-40000	-7.72	25	Pass
40C 120V	a	5180	Ant1	5179.96	-40000	-7.72	25	Pass
50C 120V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 102V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 138V	a	5200	Ant1	5200	0	0	25	Pass
-20C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
-10C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
0C 120V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
10C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
30C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
40C 120V	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
50C 120V	a	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 102V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 138V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-20C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
0C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
10C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
30C 120V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
50C 120V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 102V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 138V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 120V	n20	5180	Ant1	5180	0	0	25	Pass
-10C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 120V	n20	5180	Ant1	5179.96	-40000	-7.72	25	Pass



40C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
50C 120V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 102V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 120V	n20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
20C 138V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-20C 120V	n20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
-10C 120V	n20	5200	Ant1	5200	0	0	25	Pass
0C 120V	n20	5200	Ant1	5200	0	0	25	Pass
10C 120V	n20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
30C 120V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 120V	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
50C 120V	n20	5200	Ant1	5199.94	-60000	-11.54	25	Pass
20C 102V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 138V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-20C 120V	n20	5240	Ant1	5239.94	-60000	-11.45	25	Pass
-10C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
10C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
30C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 120V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
50C 120V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 102V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-20C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-10C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
10C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
30C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
40C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 120V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 102V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 138V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-20C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-10C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
10C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
40C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
50C 120V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 102V	ac20	5180	Ant1	5179.96	-40000	-7.72	25	Pass



20C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 138V	ac20	5180	Ant1	5180	0	0	25	Pass
-20C 120V	ac20	5180	Ant1	5179.94	-60000	-11.58	25	Pass
-10C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
0C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
30C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 120V	ac20	5180	Ant1	5180	0	0	25	Pass
50C 120V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 102V	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 120V	ac20	5200	Ant1	5200	0	0	25	Pass
20C 138V	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-20C 120V	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-10C 120V	ac20	5200	Ant1	5200	0	0	25	Pass
0C 120V	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
10C 120V	ac20	5200	Ant1	5199.96	-40000	-7.69	25	Pass
30C 120V	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 120V	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
50C 120V	ac20	5200	Ant1	5200	0	0	25	Pass
20C 102V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 138V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-20C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 120V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
30C 120V	ac20	5240	Ant1	5240	0	0	25	Pass
40C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
50C 120V	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 102V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 138V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-20C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-10C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
10C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
30C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
40C 120V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 102V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 138V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-20C 120V	ac40	5230	Ant1	5230	0	0	25	Pass




-10C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
0C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
10C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
30C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
40C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
50C 120V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 102V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 138V	ac80	5210	Ant1	5210	0	0	25	Pass
-20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
-10C 120V	ac80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
0C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
30C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
40C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
50C 120V	ac80	5210	Ant1	5210	0	0	25	Pass




Test Graphs

Freq. Stability 20C 102V a 5180MHz Ant1

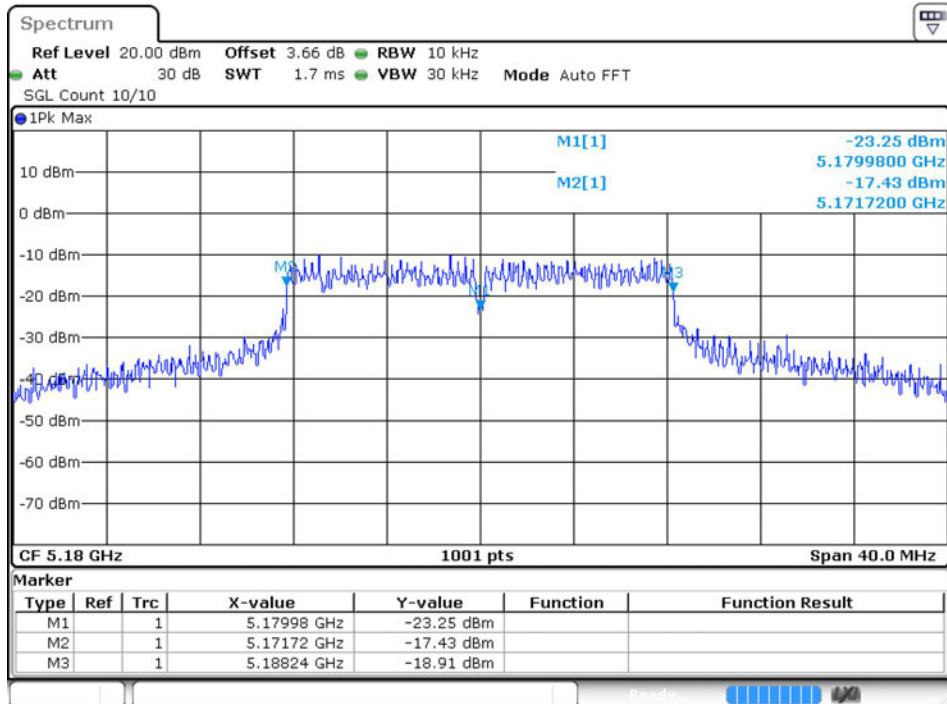


Freq. Stability 20C 120V a 5180MHz Ant1

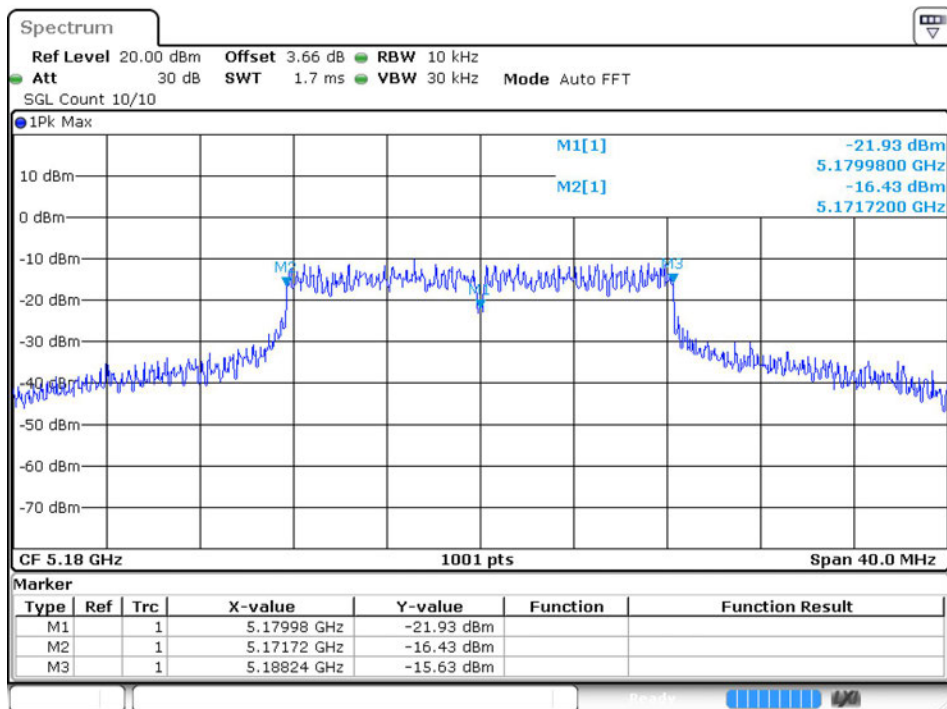




Freq. Stability 20C 138V a 5180MHz Ant1

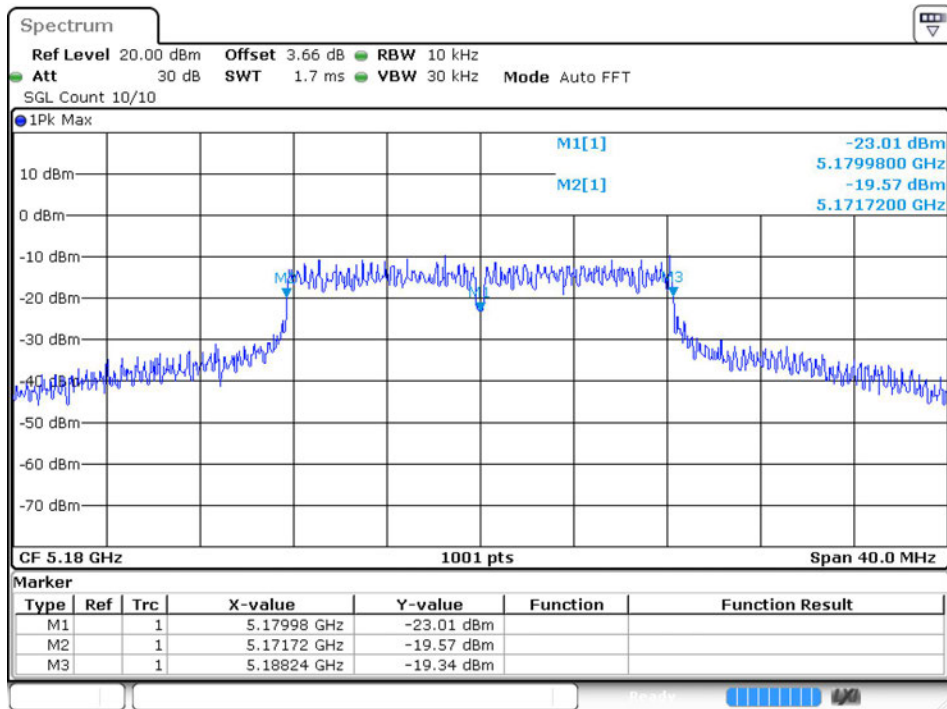


Freq. Stability -20C 120V a 5180MHz Ant1

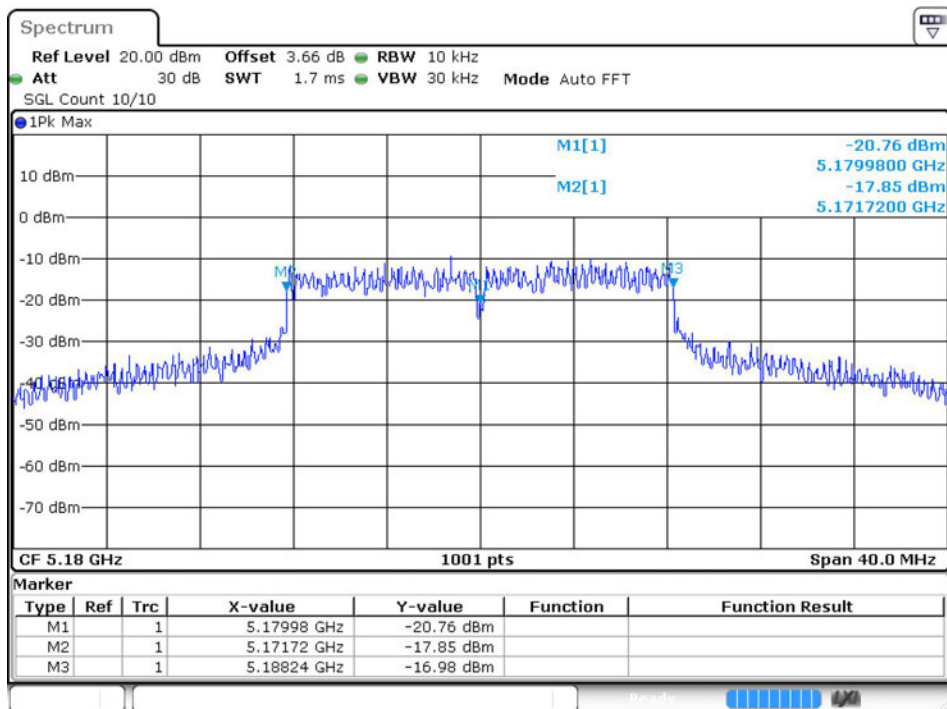




Freq. Stability -10C 120V a 5180MHz Ant1

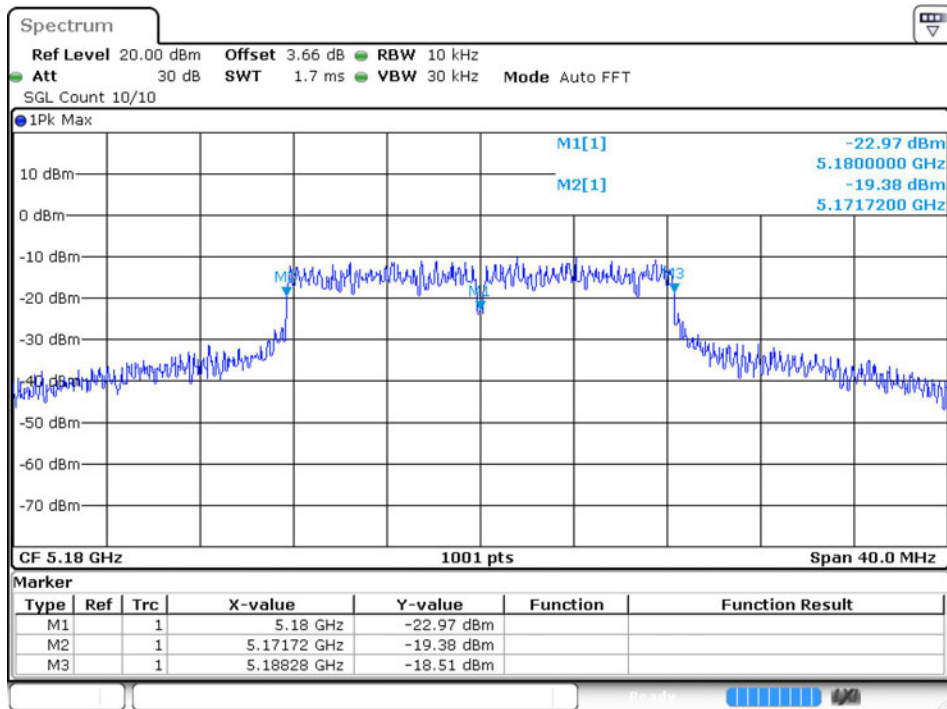


Freq. Stability 0C 120V a 5180MHz Ant1

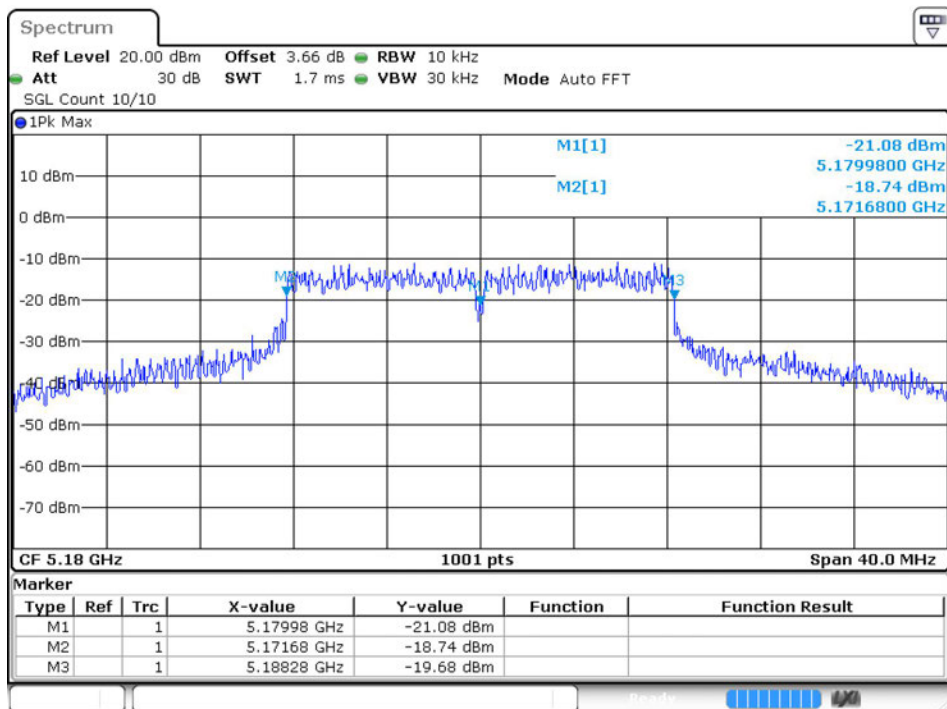




Freq. Stability 10C 120V a 5180MHz Ant1

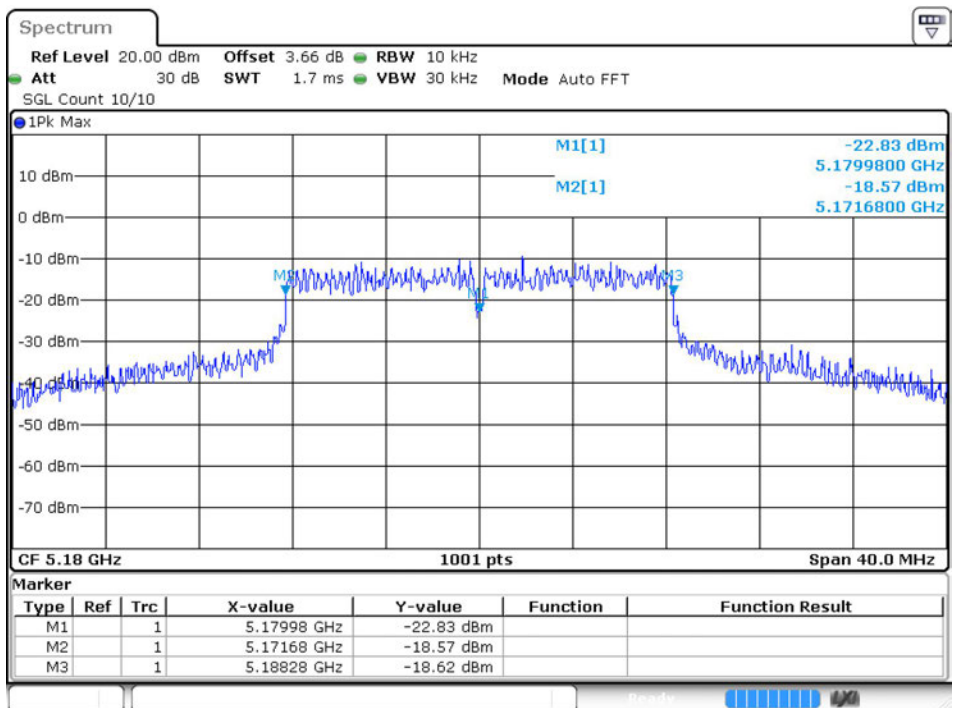


Freq. Stability 30C 120V a 5180MHz Ant1

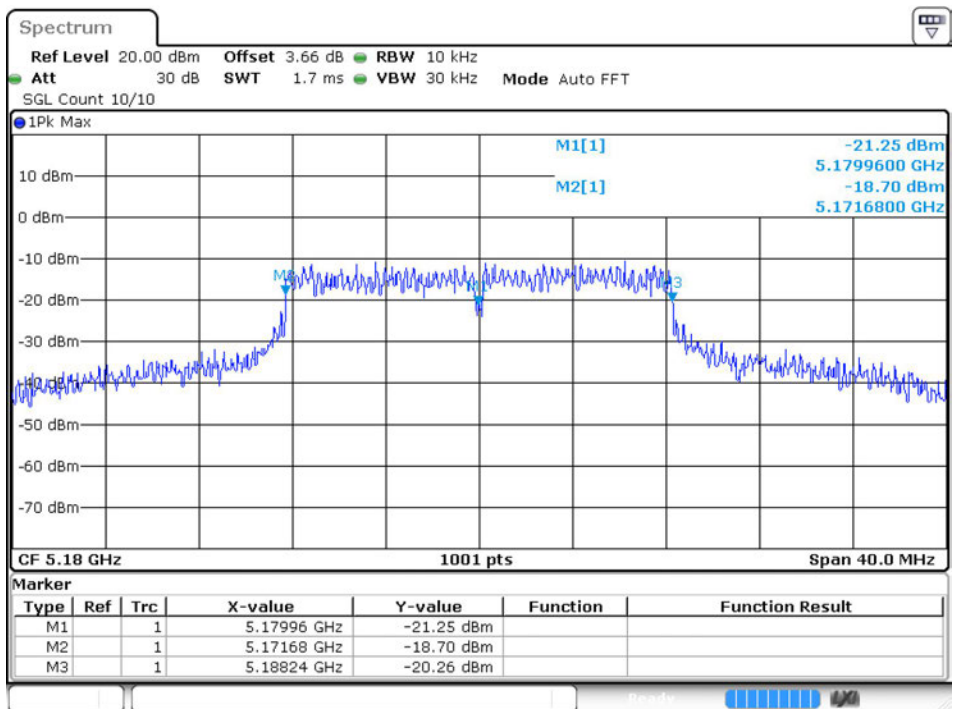




Freq. Stability 40C 120V a 5180MHz Ant1

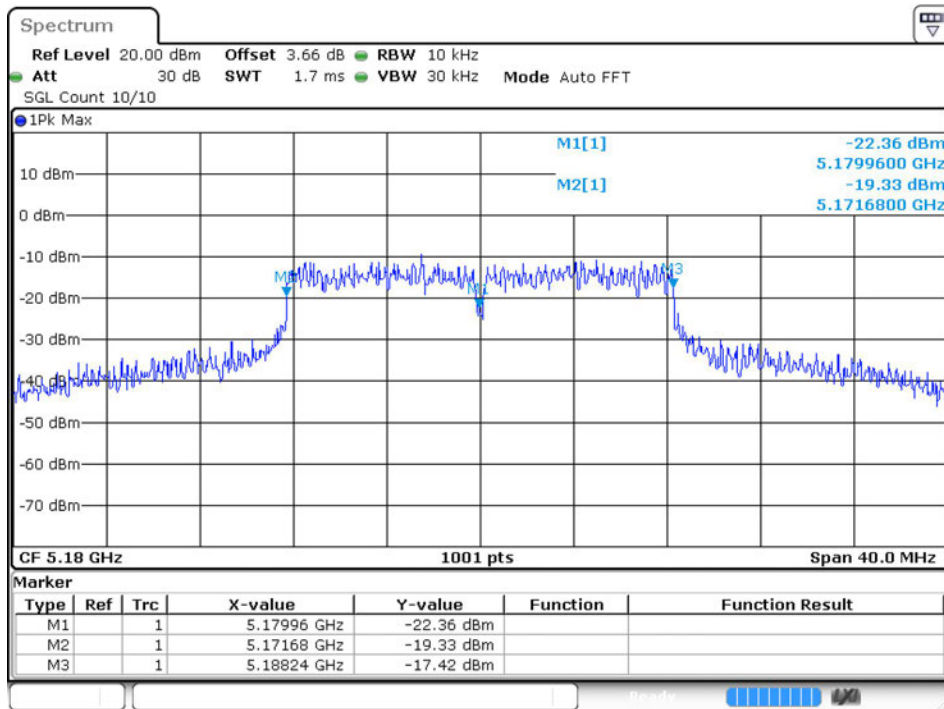


Freq. Stability 50C 120V a 5180MHz Ant1

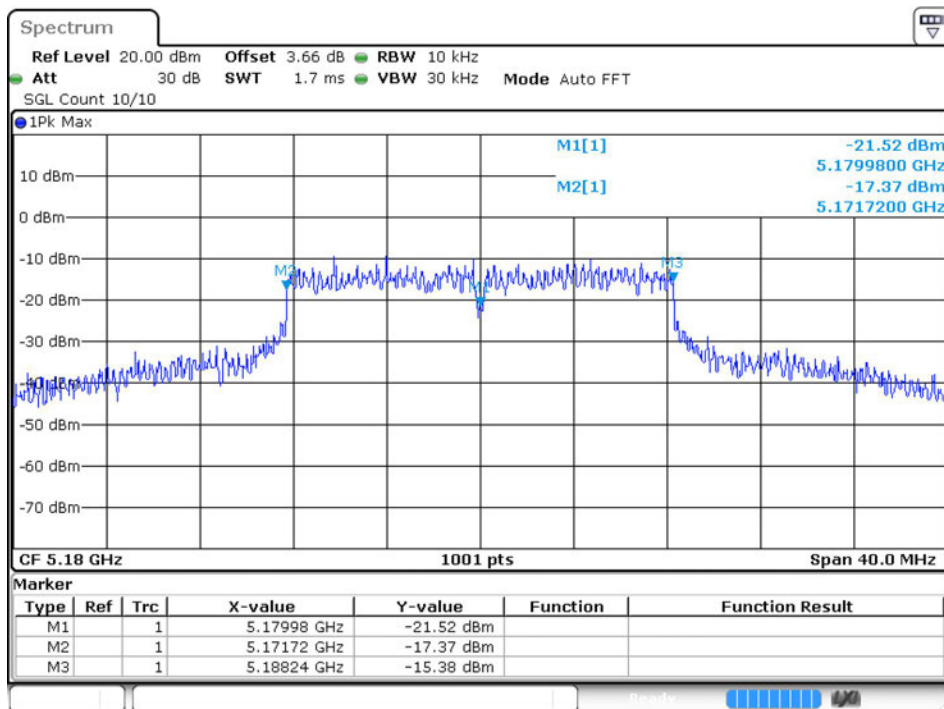




Freq. Stability 20C 102V a 5200MHz Ant1

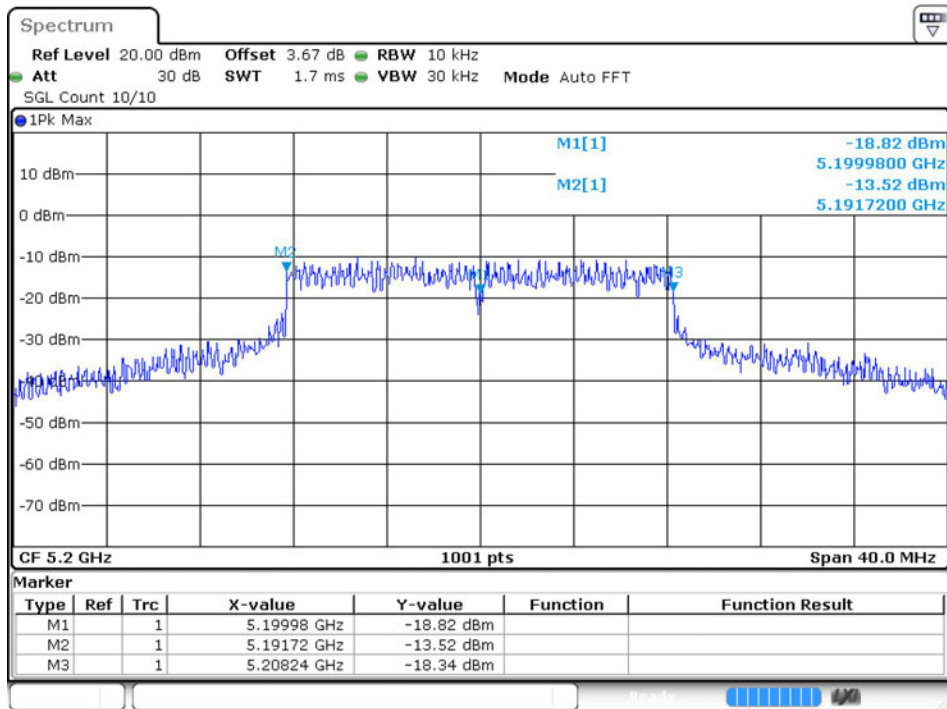


Freq. Stability 20C 120V a 5200MHz Ant1

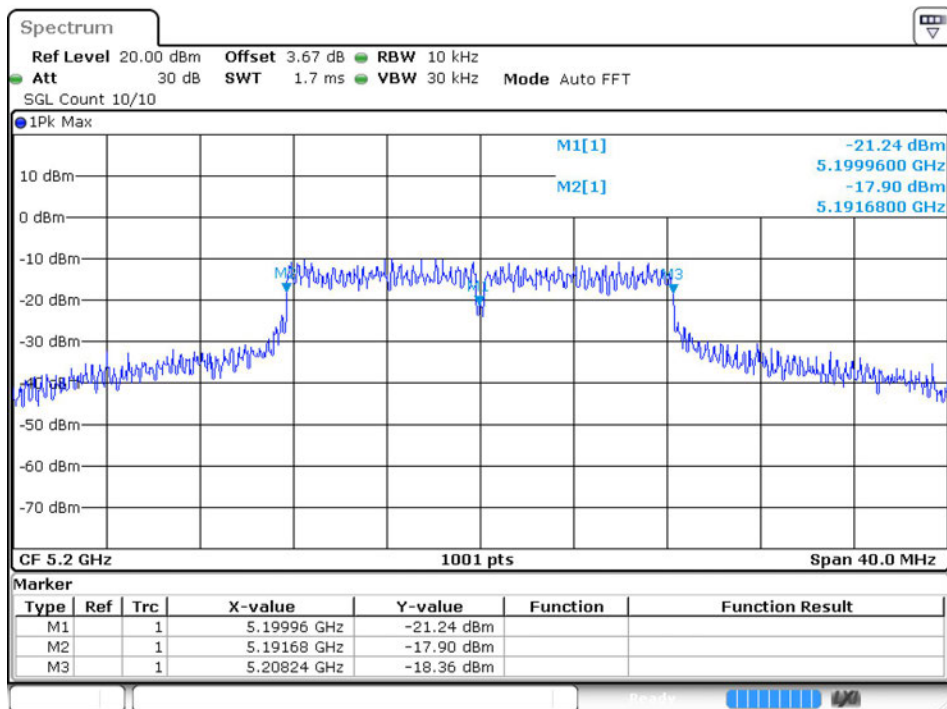




Freq. Stability 20C 138V a 5200MHz Ant1

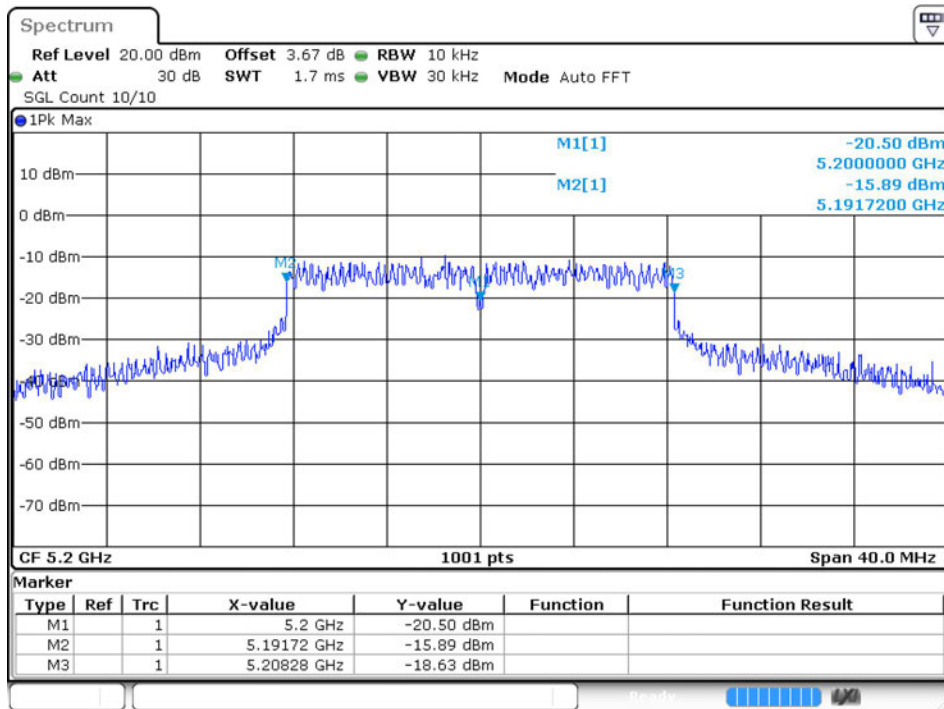


Freq. Stability -20C 120V a 5200MHz Ant1

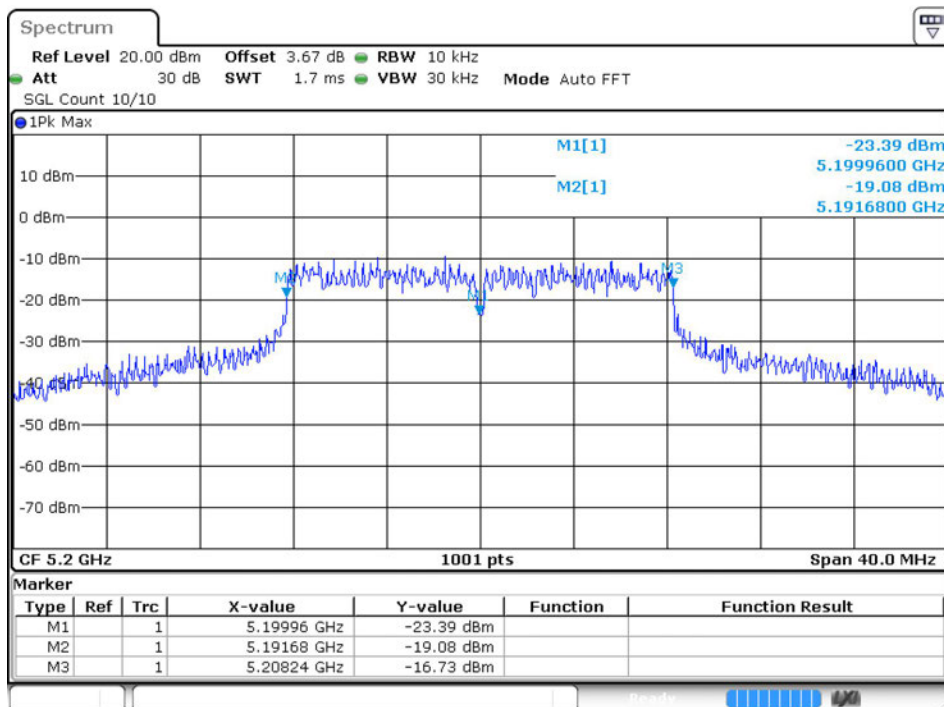




Freq. Stability -10C 120V a 5200MHz Ant1

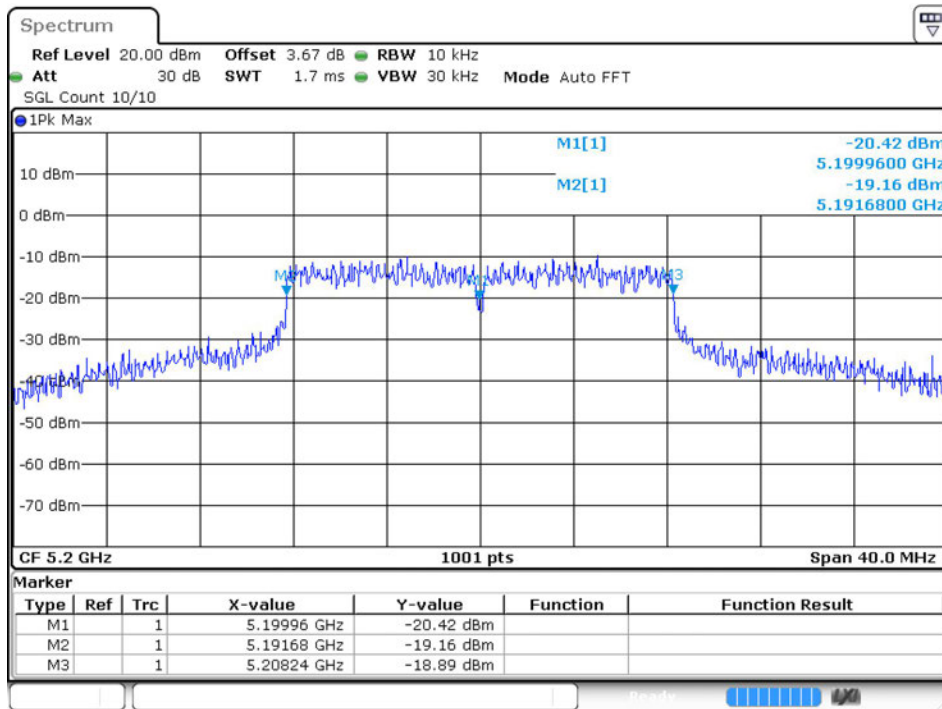


Freq. Stability 0C 120V a 5200MHz Ant1

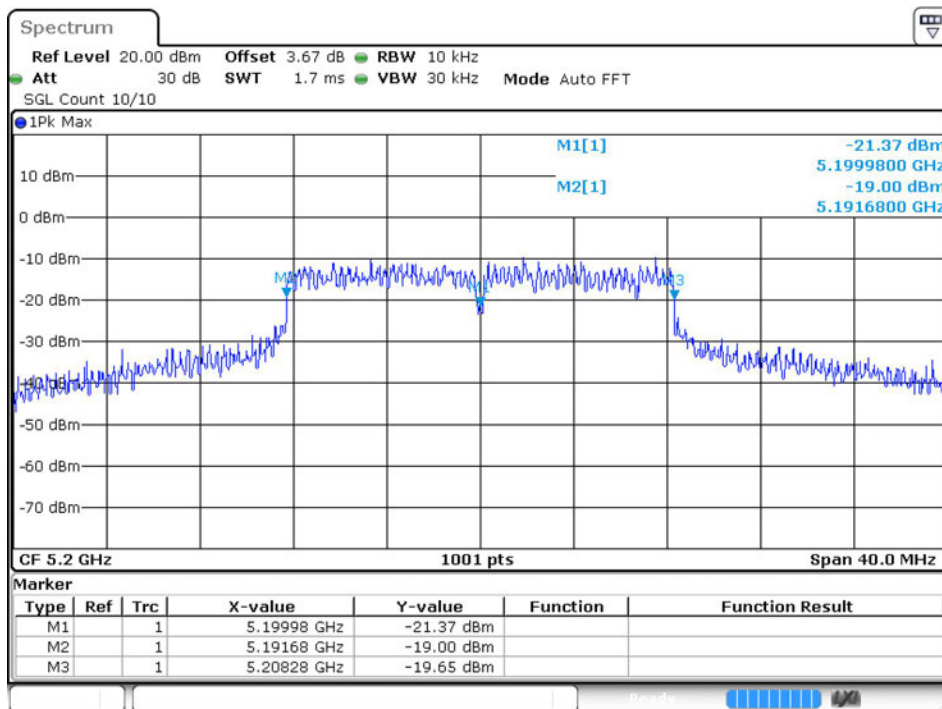




Freq. Stability 10C 120V a 5200MHz Ant1

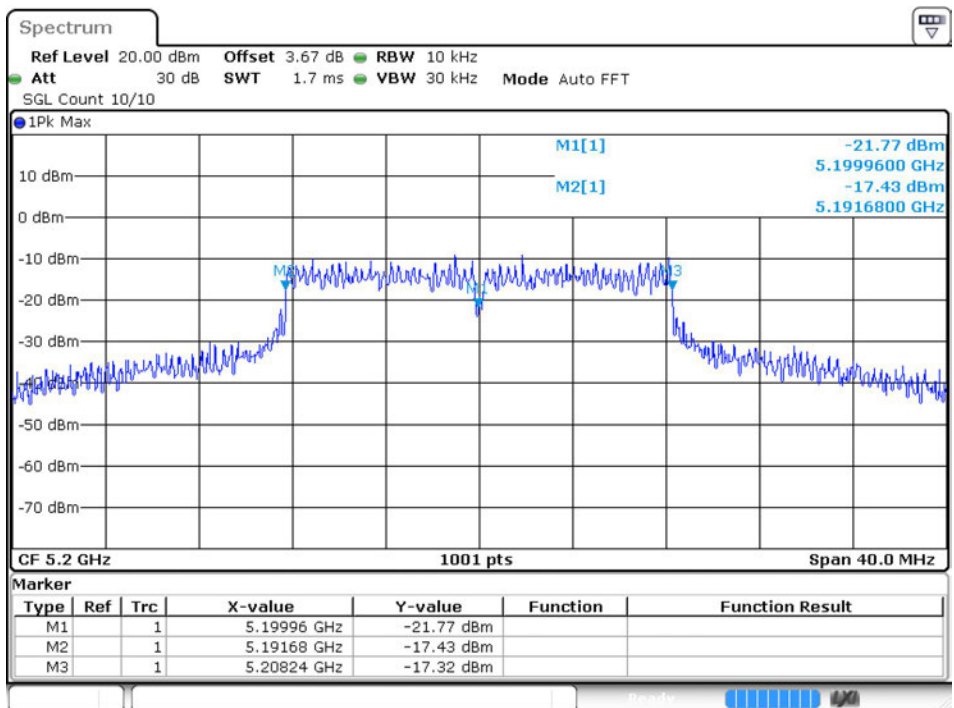


Freq. Stability 30C 120V a 5200MHz Ant1

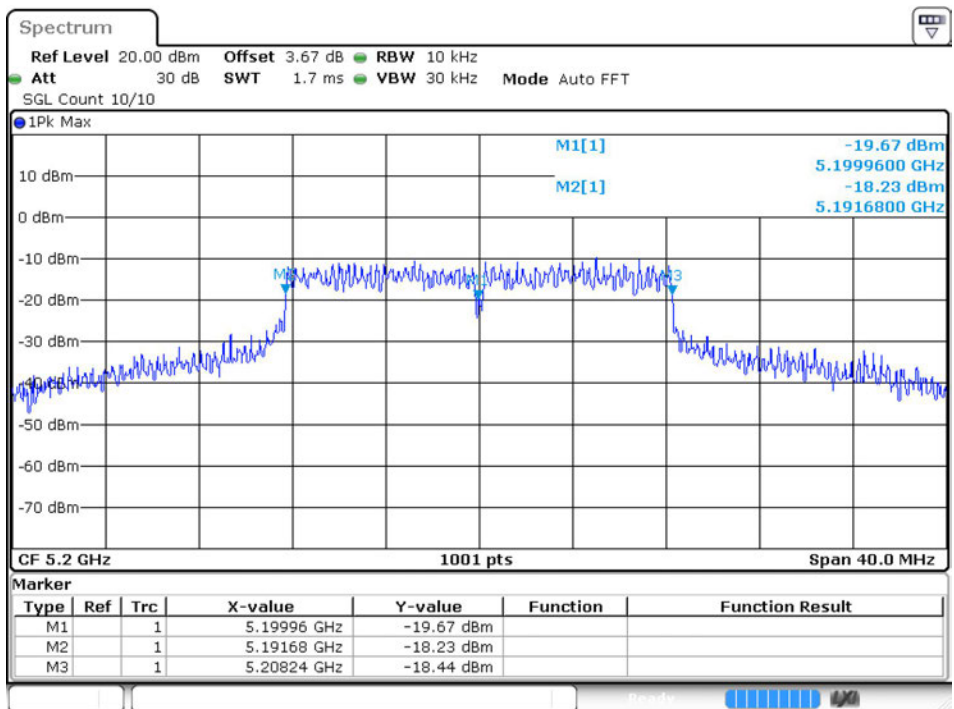




Freq. Stability 40C 120V a 5200MHz Ant1

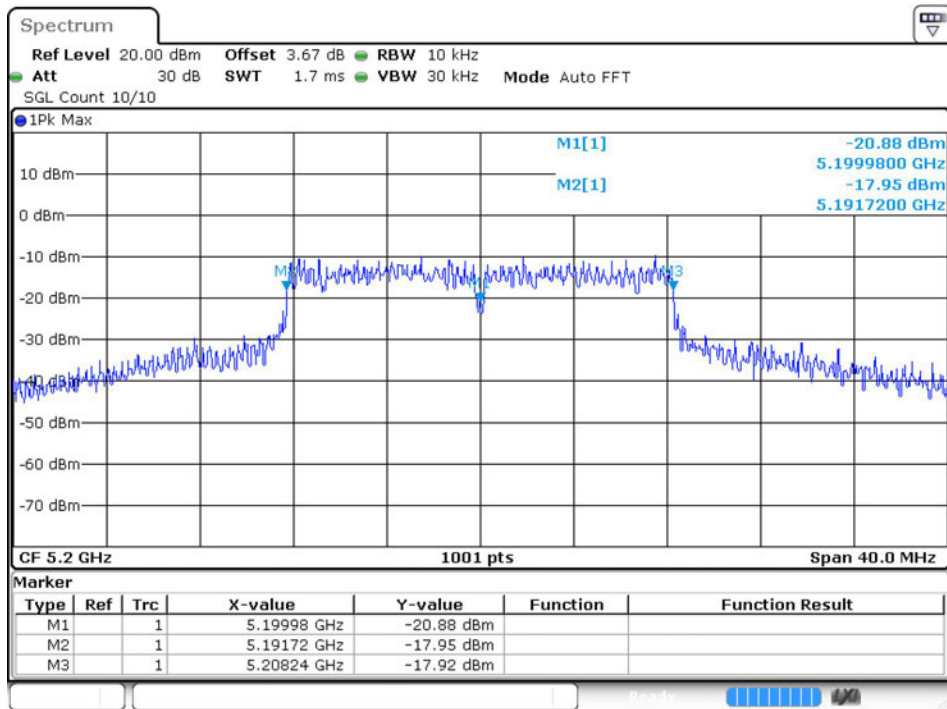


Freq. Stability 50C 120V a 5200MHz Ant1

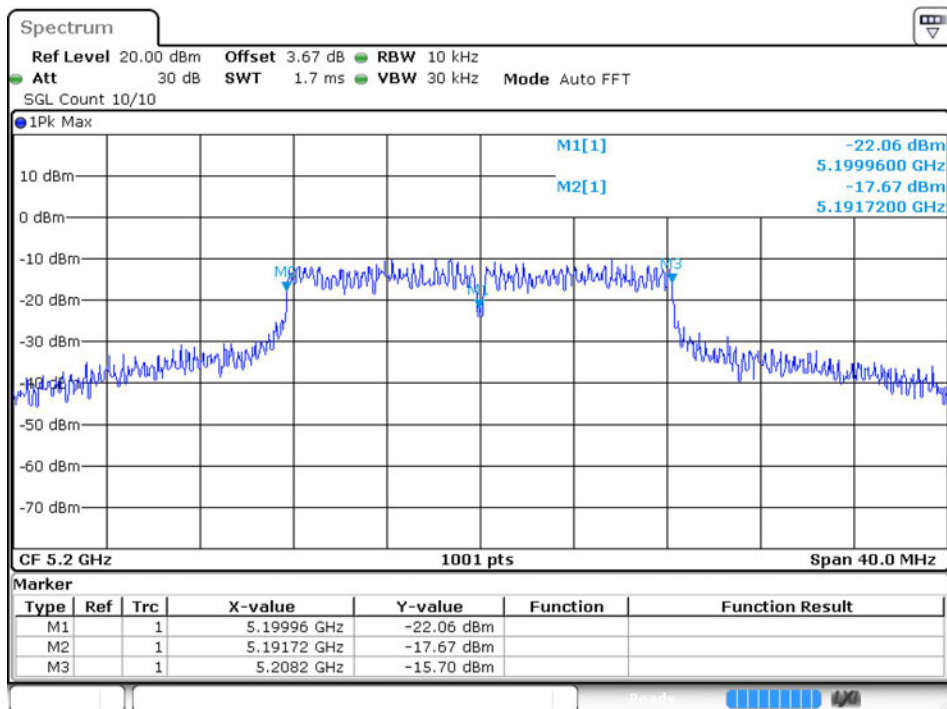




Freq. Stability 20C 102V a 5240MHz Ant1

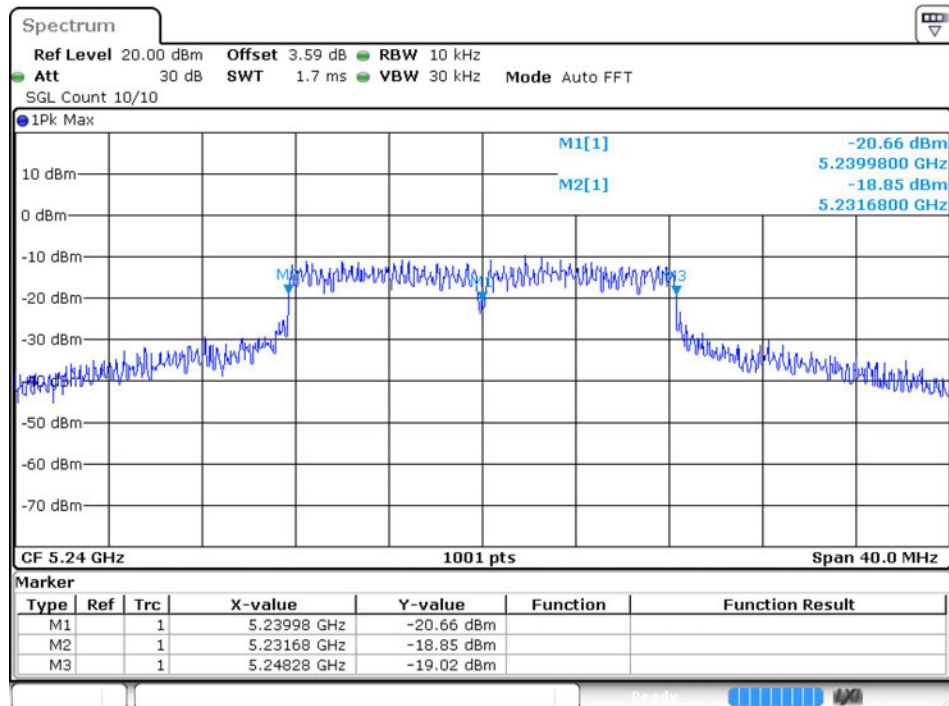


Freq. Stability 20C 120V a 5240MHz Ant1

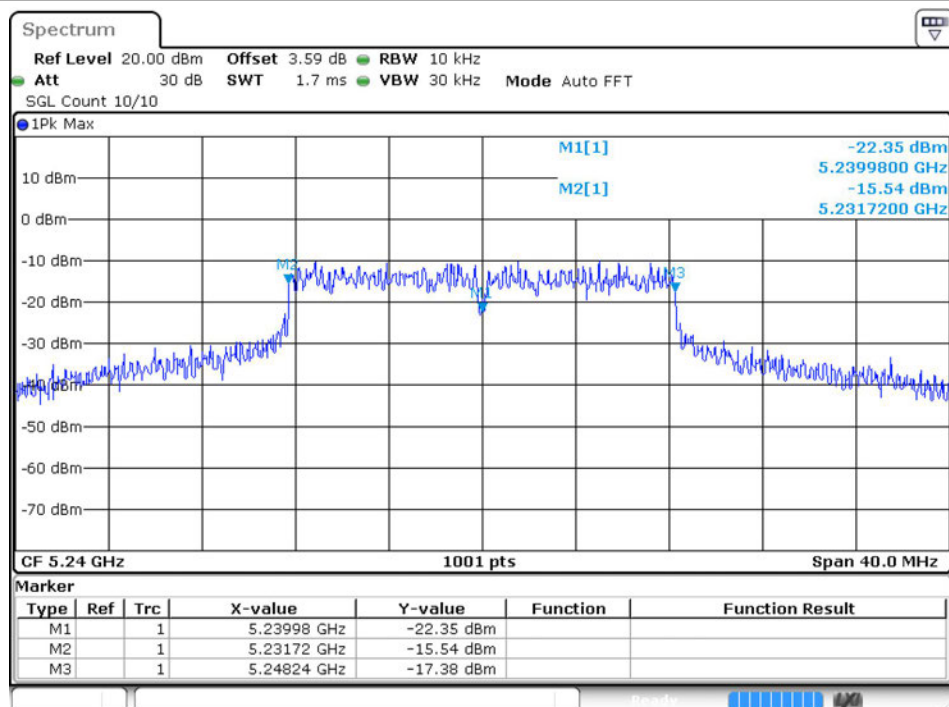




Freq. Stability 20C 138V a 5240MHz Ant1

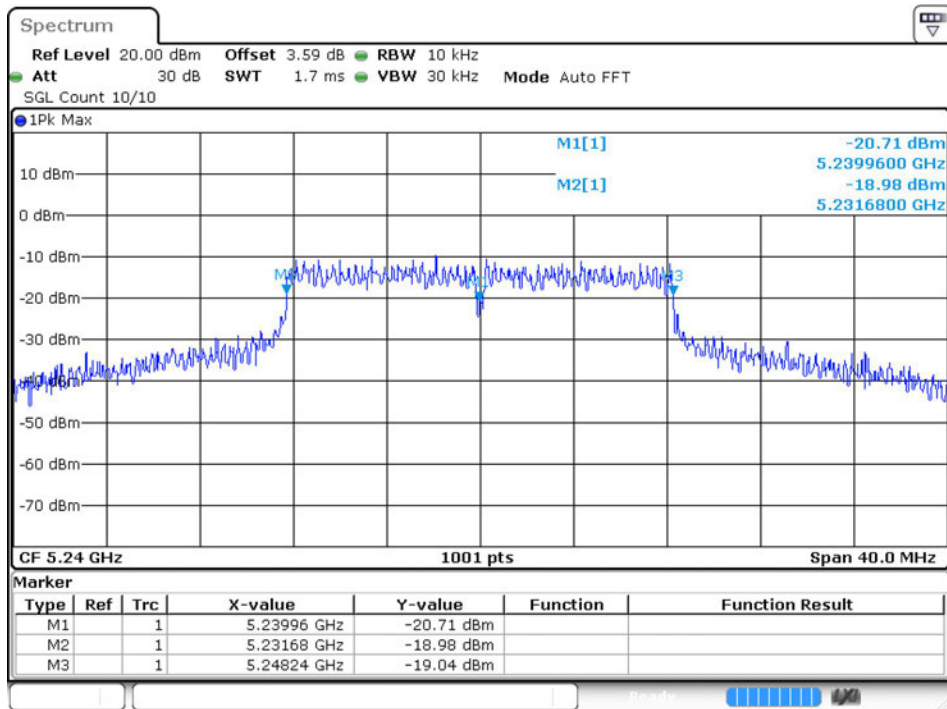


Freq. Stability -20C 120V a 5240MHz Ant1

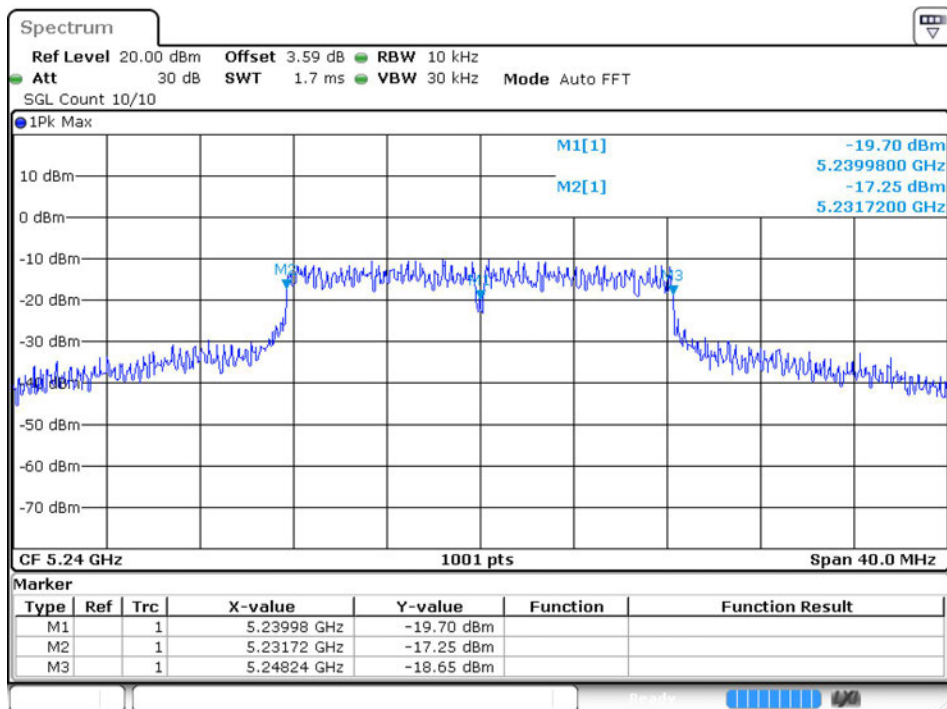




Freq. Stability -10C 120V a 5240MHz Ant1

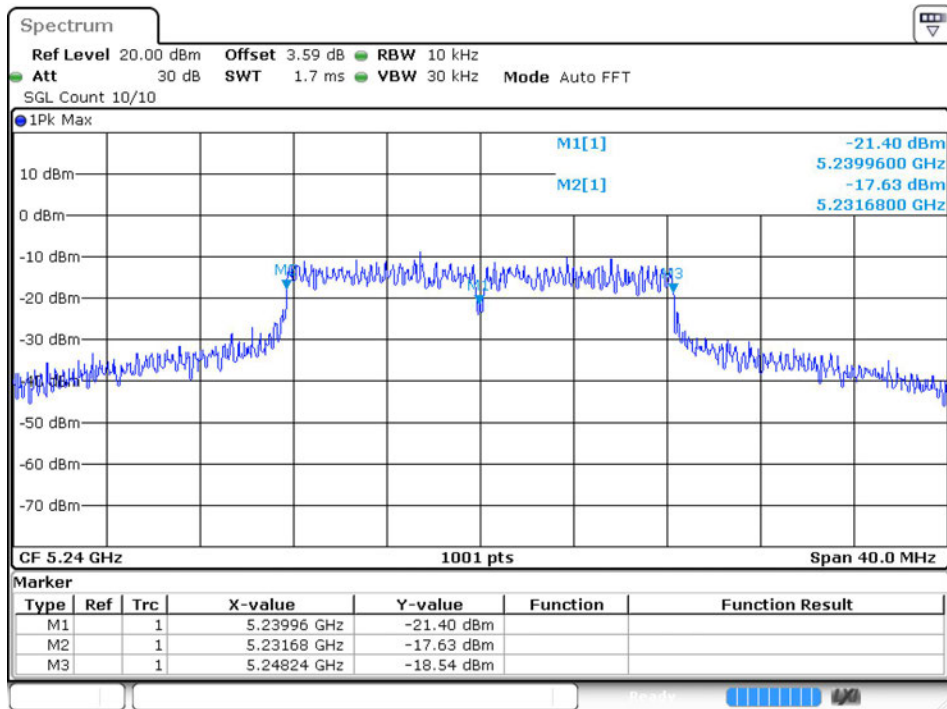


Freq. Stability 0C 120V a 5240MHz Ant1

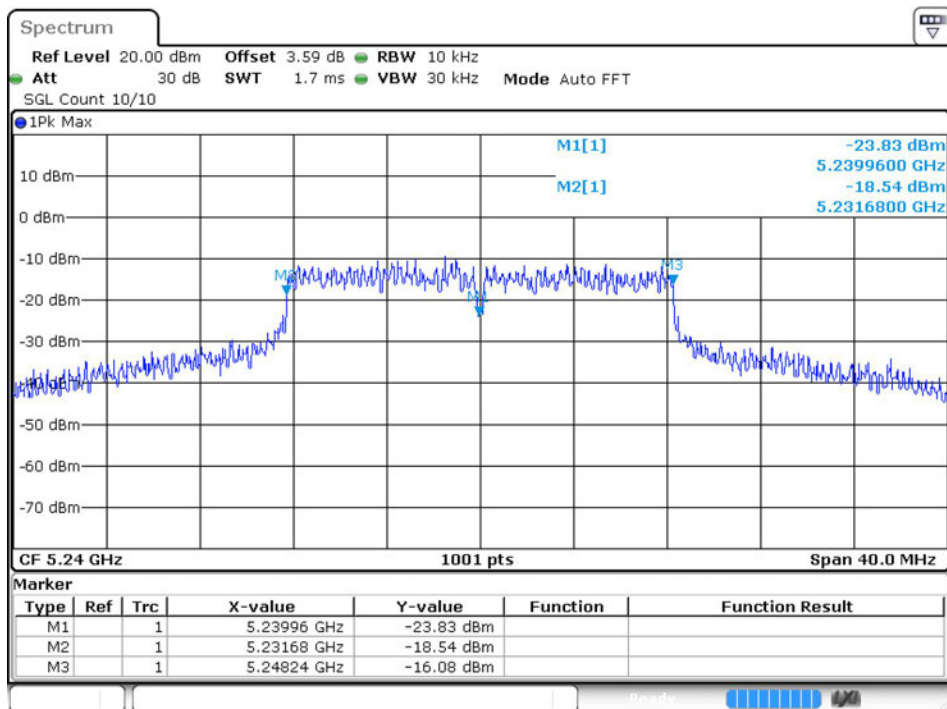




Freq. Stability 10C 120V a 5240MHz Ant1

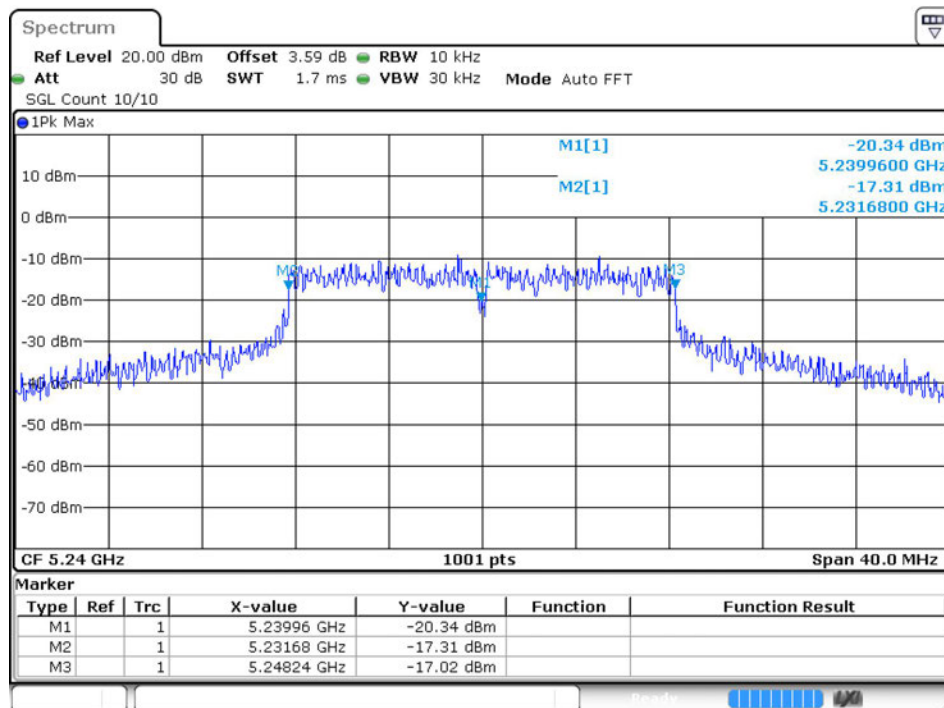


Freq. Stability 30C 120V a 5240MHz Ant1

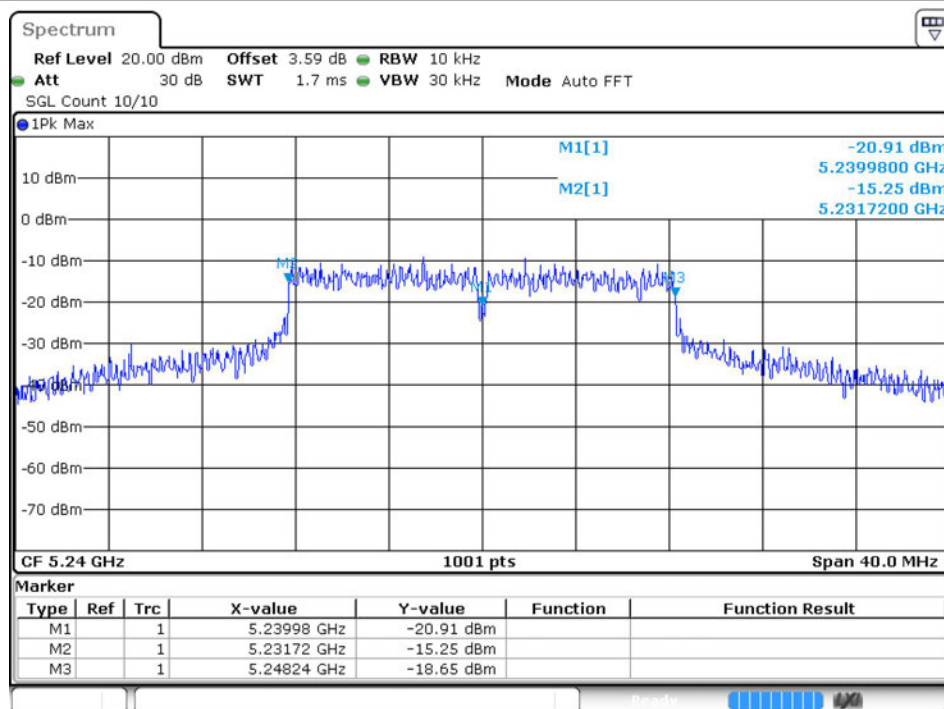




Freq. Stability 40C 120V a 5240MHz Ant1

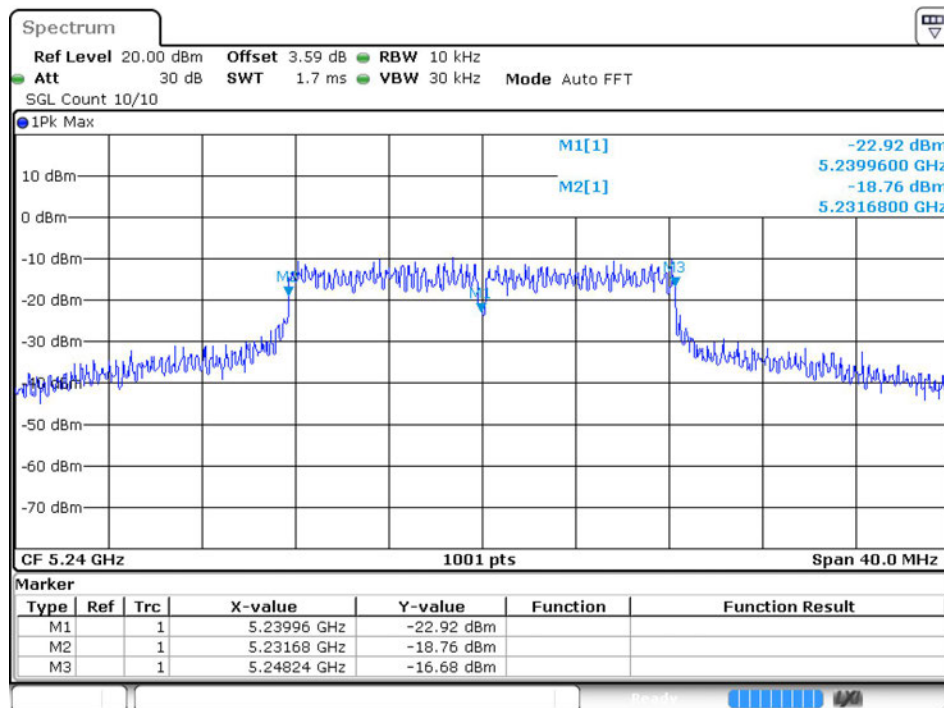


Freq. Stability 50C 120V a 5240MHz Ant1

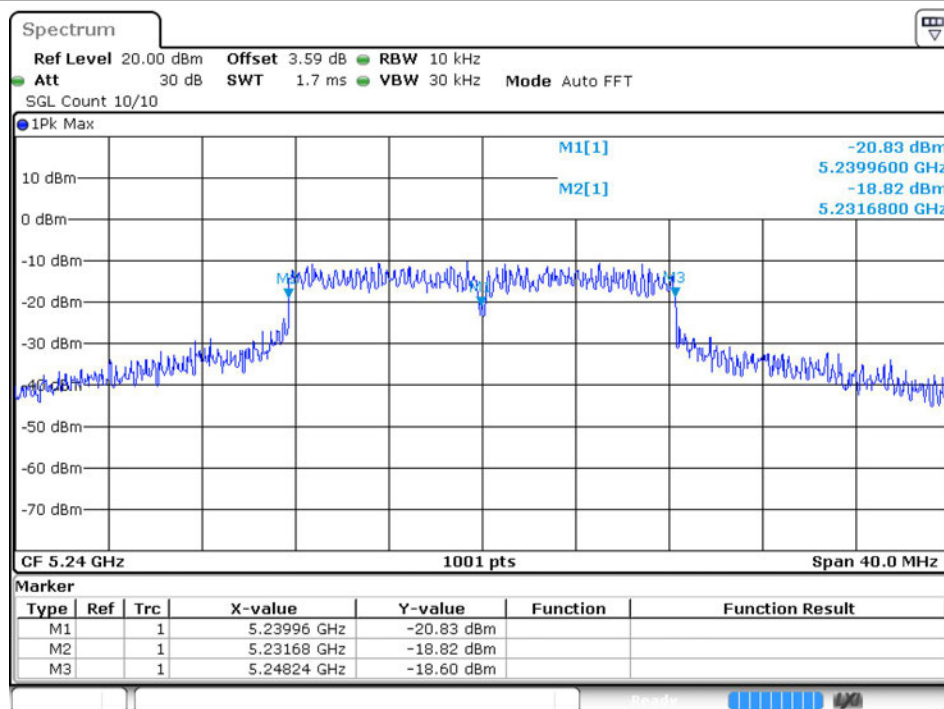




Freq. Stability 20C 102V n20 5180MHz Ant1

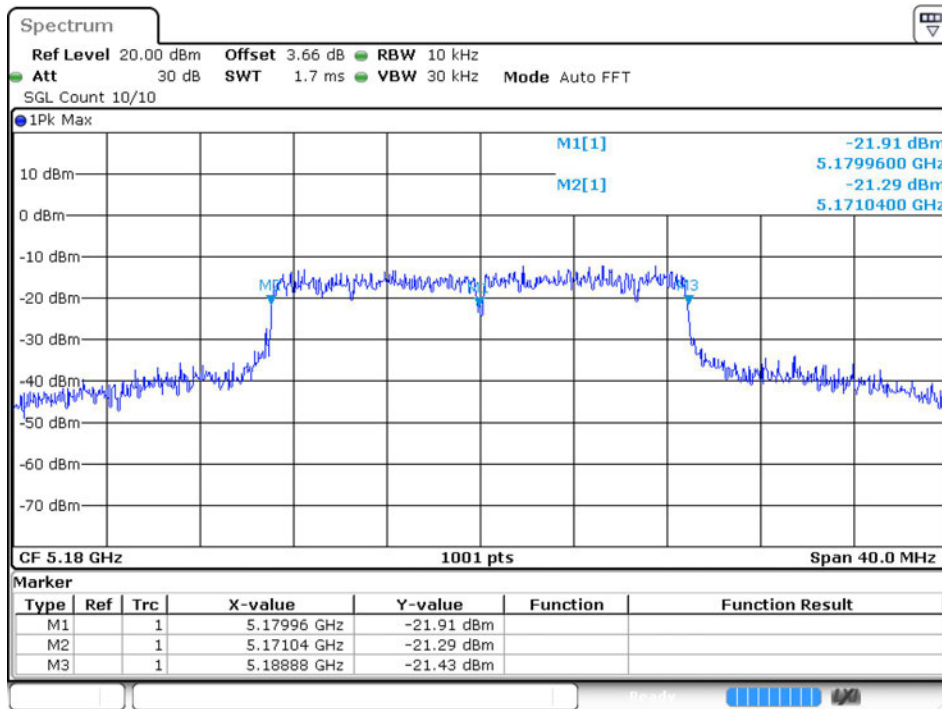


Freq. Stability 20C 120V n20 5180MHz Ant1

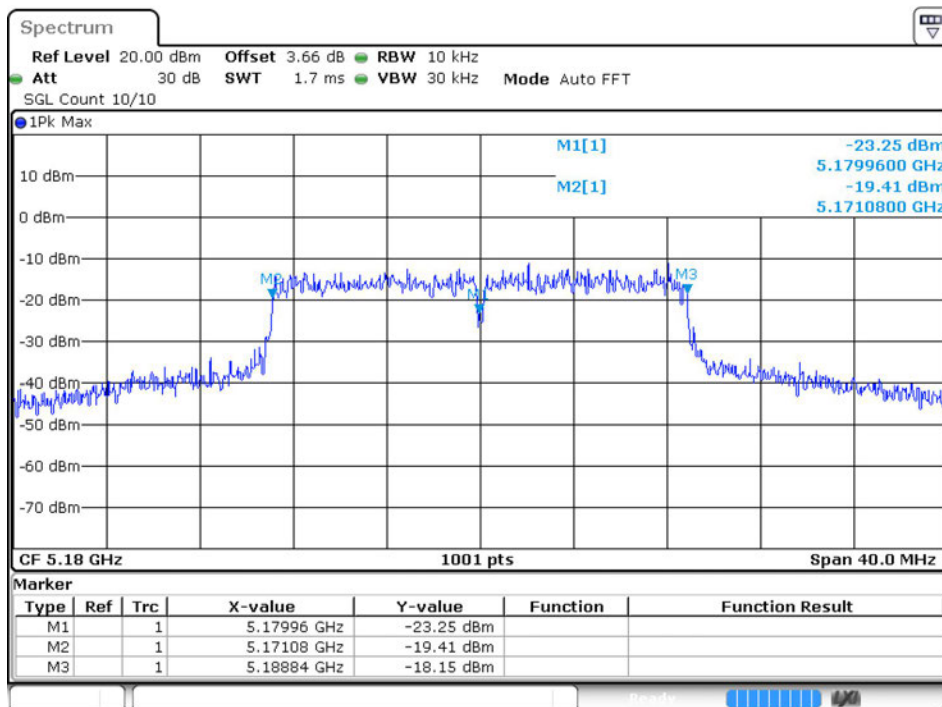




Freq. Stability 20C 138V n20 5180MHz Ant1

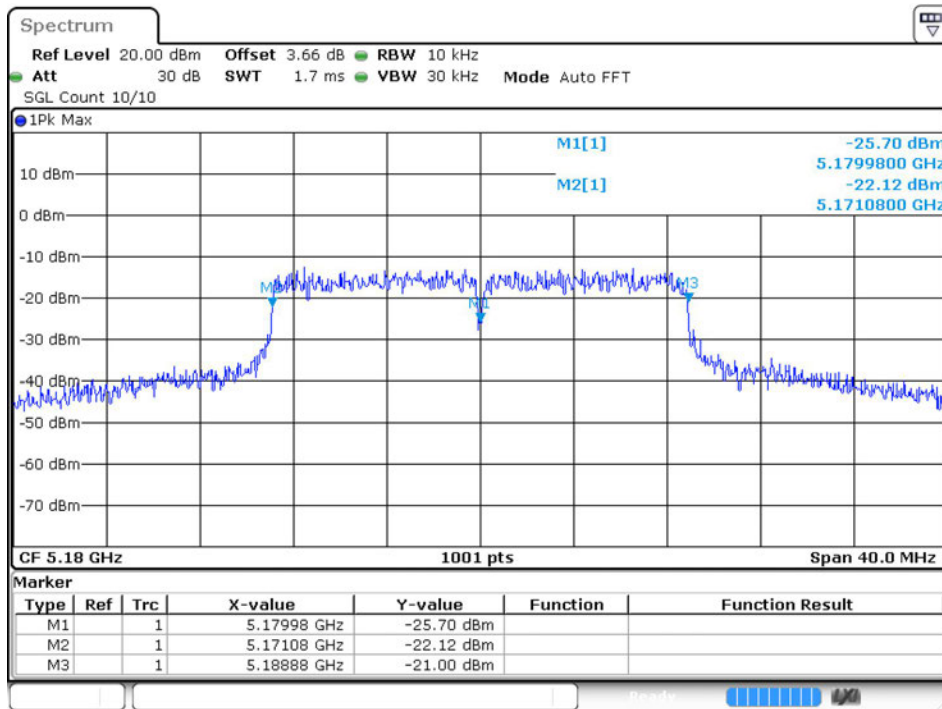


Freq. Stability -20C 120V n20 5180MHz Ant1

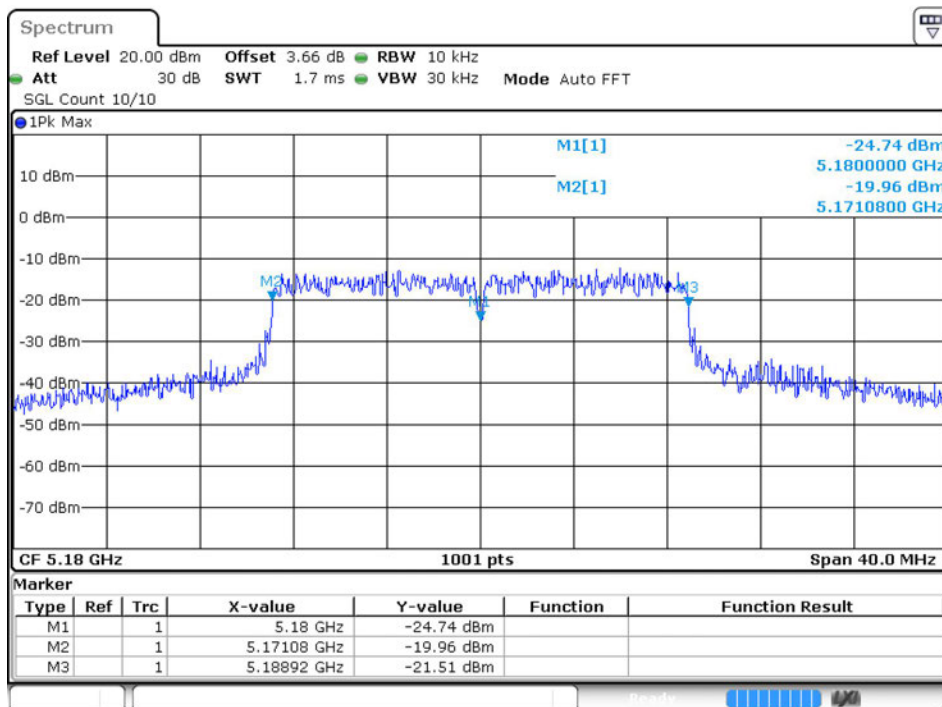




Freq. Stability -10C 120V n20 5180MHz Ant1

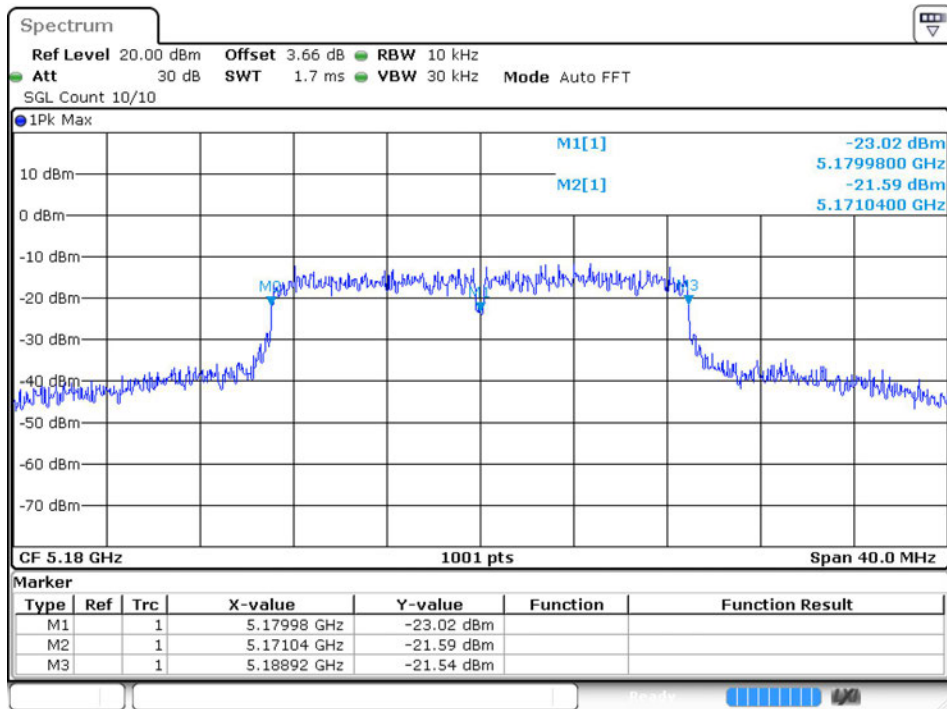


Freq. Stability 0C 120V n20 5180MHz Ant1

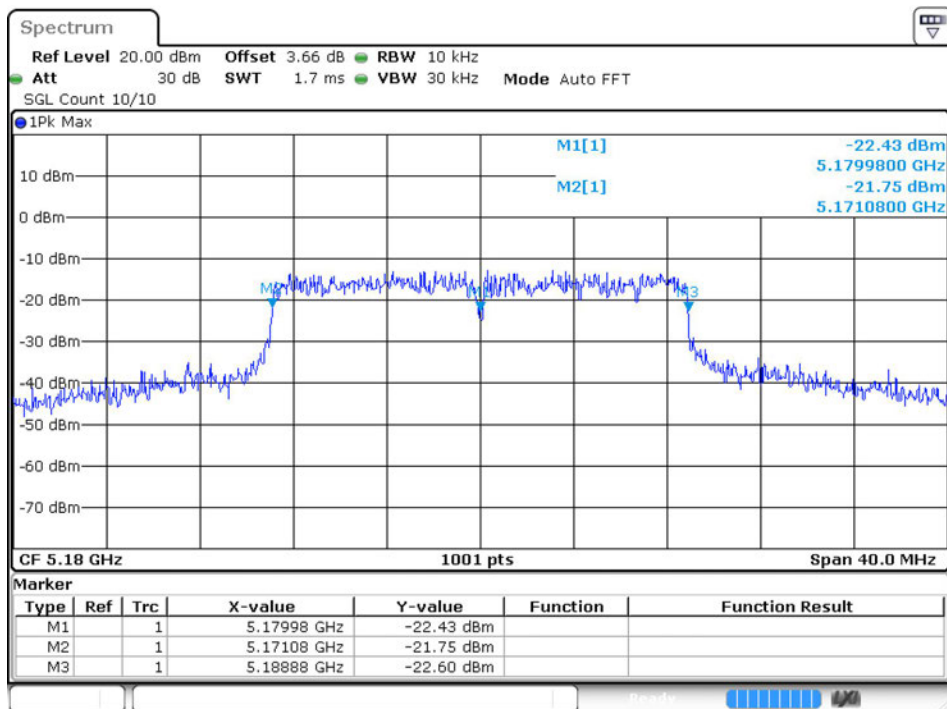




Freq. Stability 10C 120V n20 5180MHz Ant1

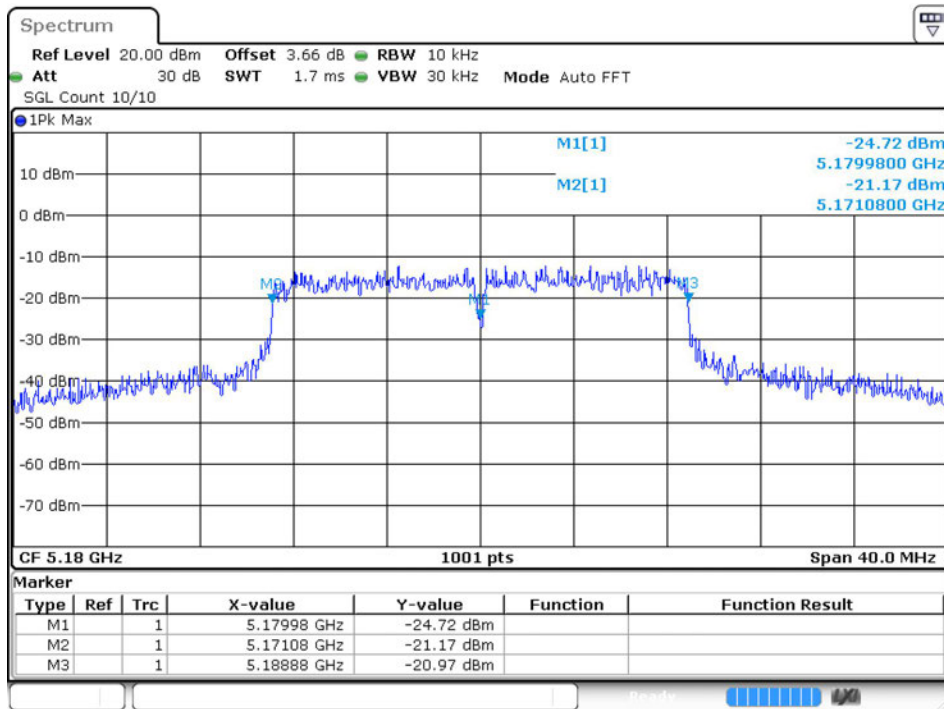


Freq. Stability 30C 120V n20 5180MHz Ant1

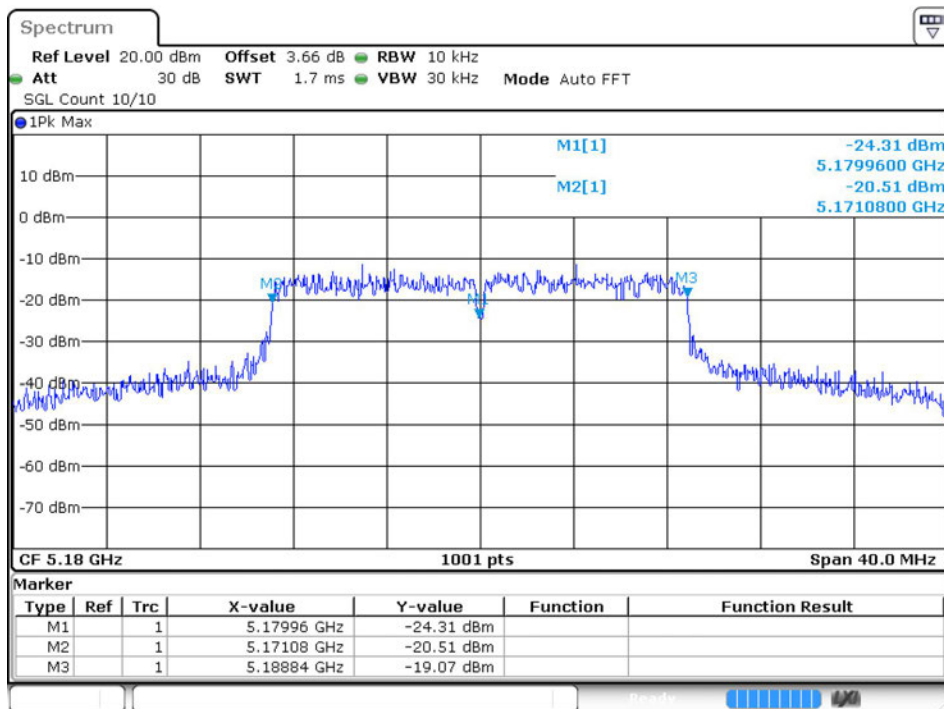




Freq. Stability 40C 120V n20 5180MHz Ant1

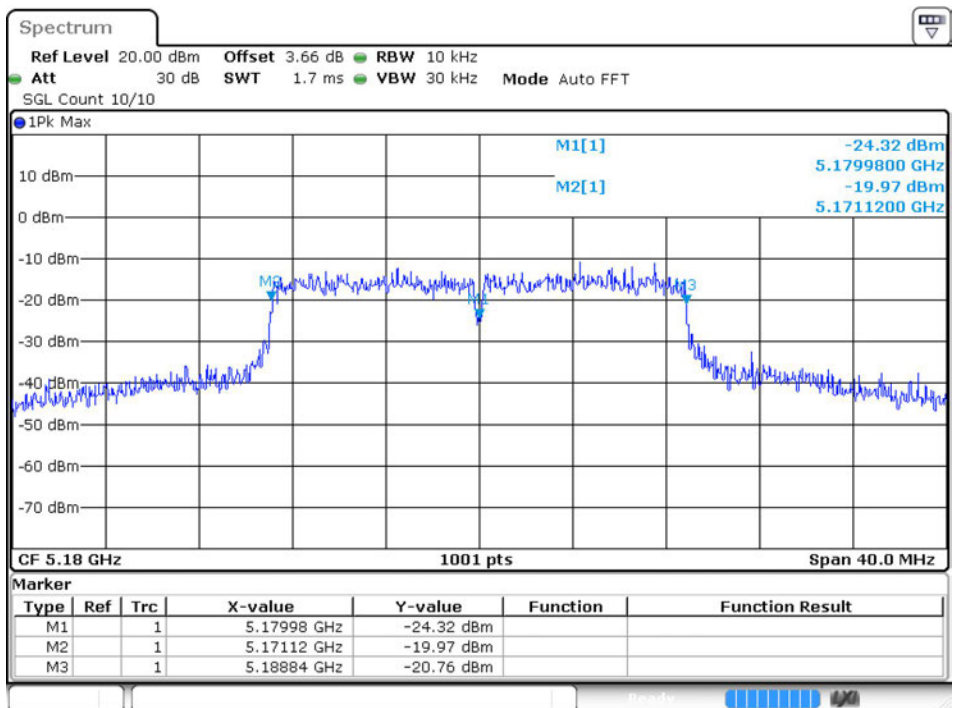


Freq. Stability 50C 120V n20 5180MHz Ant1

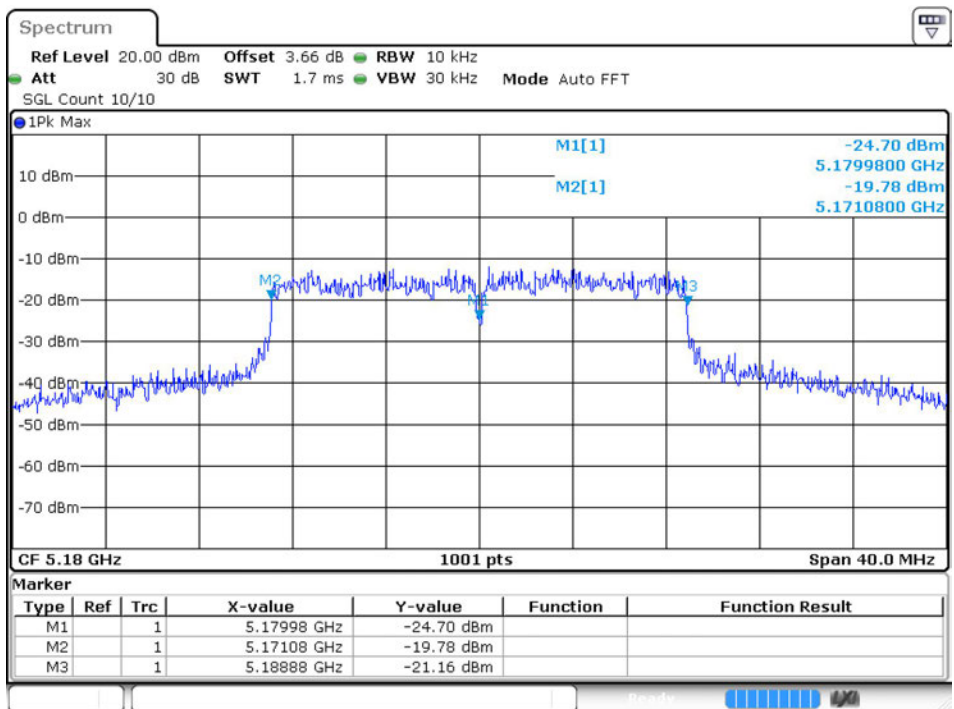




Freq. Stability 20C 102V n20 5200MHz Ant1

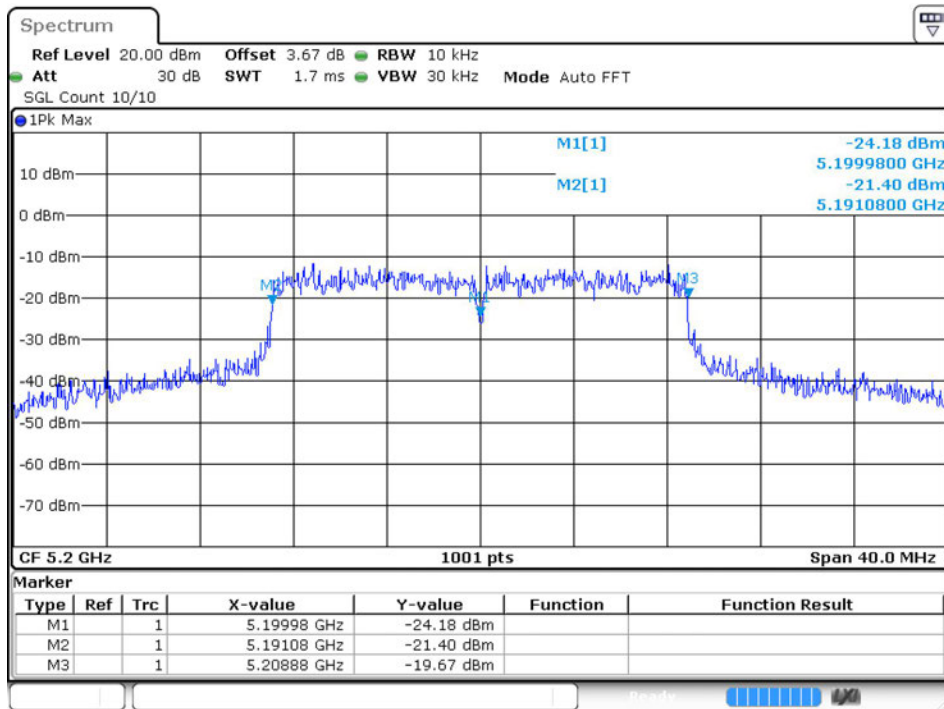


Freq. Stability 20C 120V n20 5200MHz Ant1

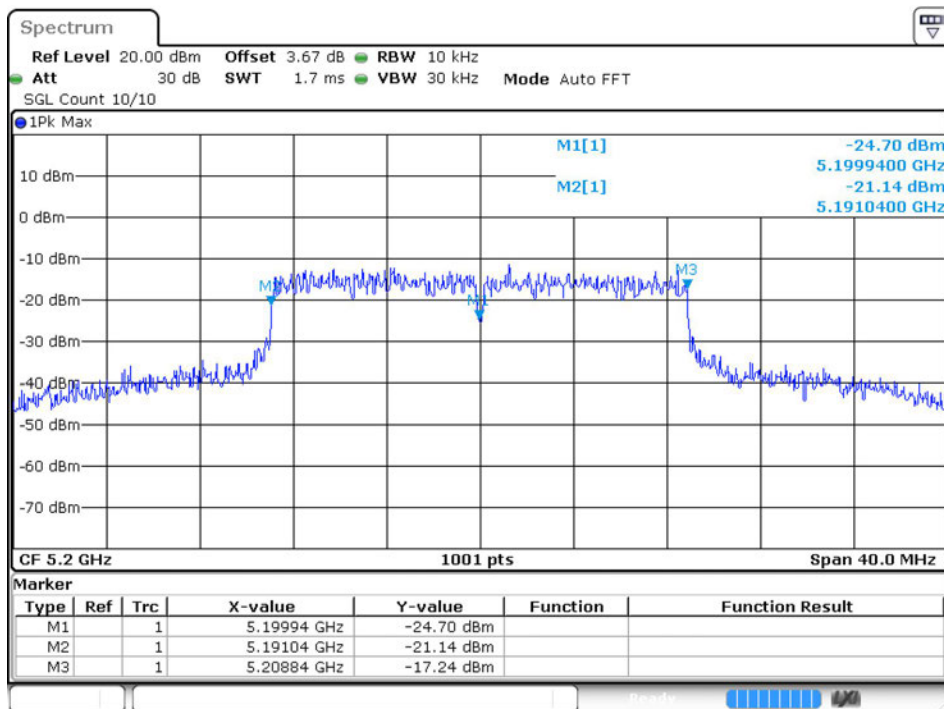




Freq. Stability 20C 138V n20 5200MHz Ant1

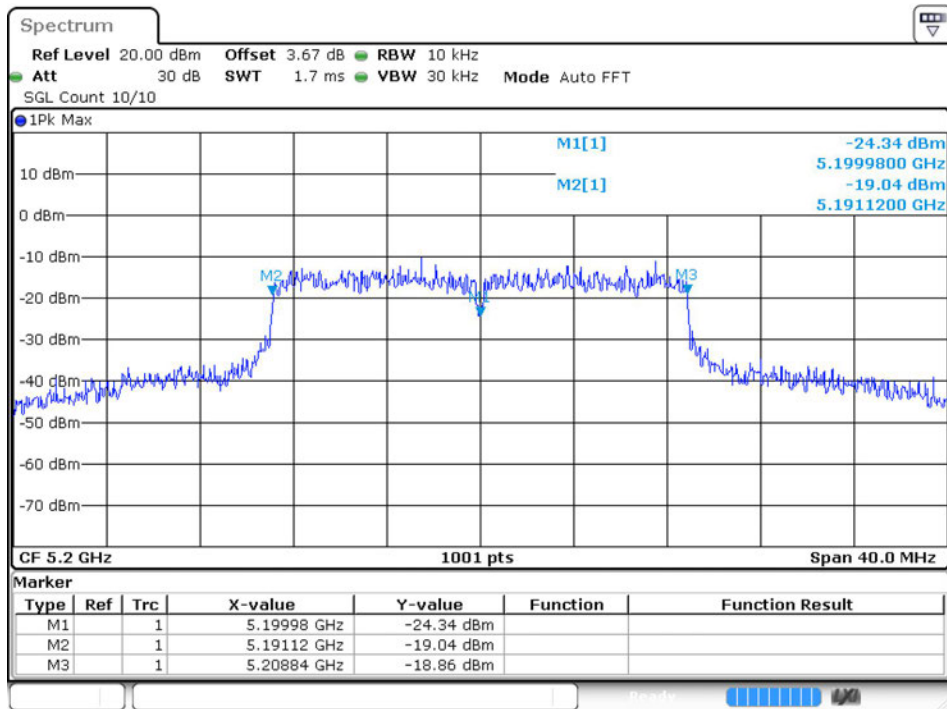


Freq. Stability -20C 120V n20 5200MHz Ant1

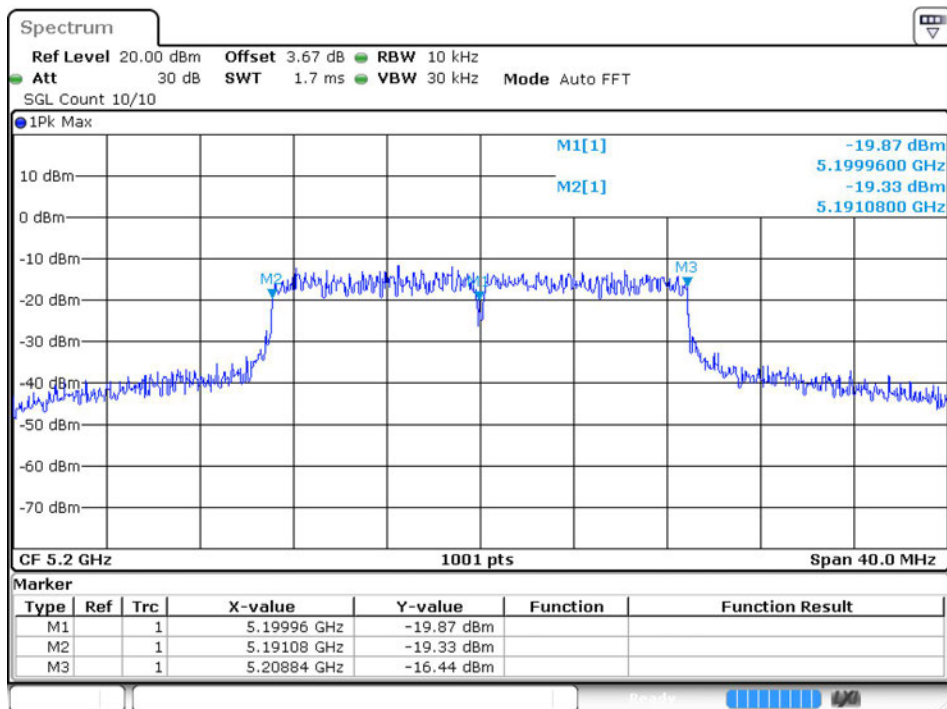




Freq. Stability -10C 120V n20 5200MHz Ant1

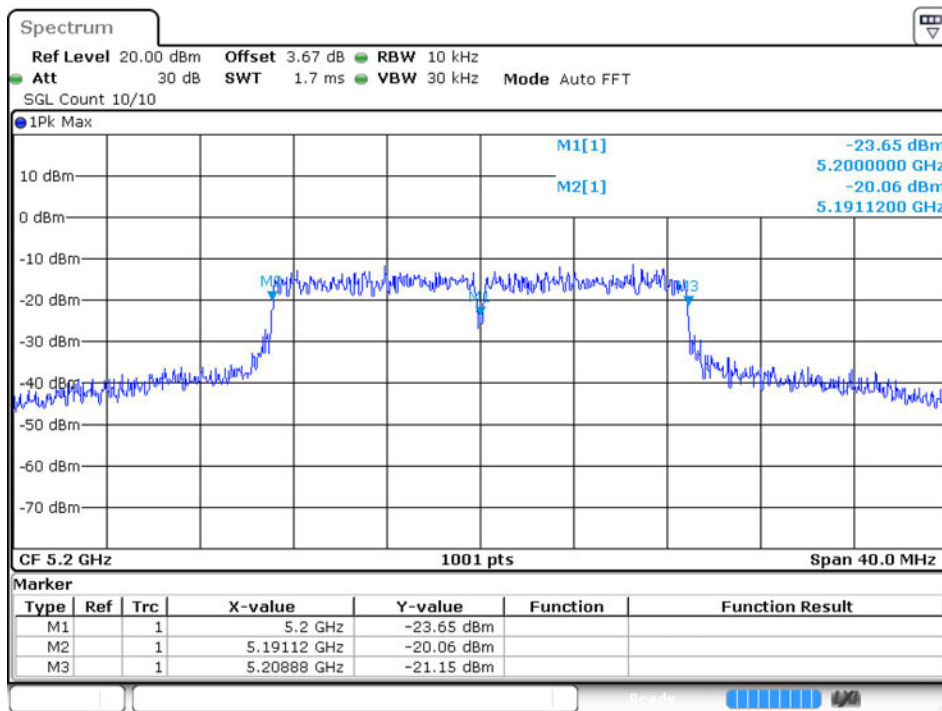


Freq. Stability 0C 120V n20 5200MHz Ant1

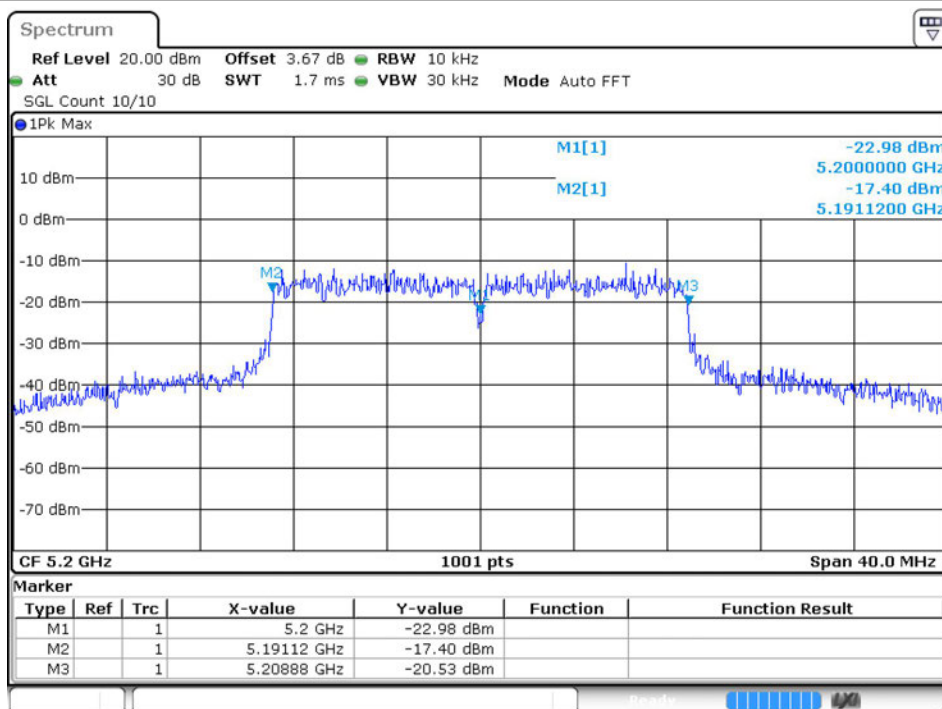



Freq. Stability 10C 120V n20 5200MHz Ant1

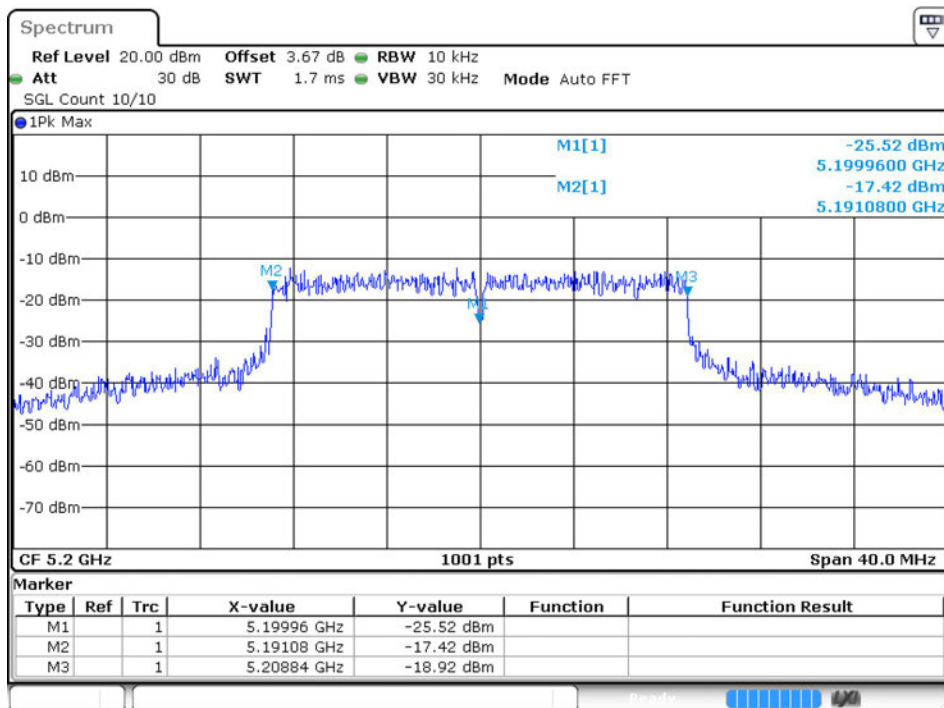

Freq. Stability 30C 120V n20 5200MHz Ant1

