






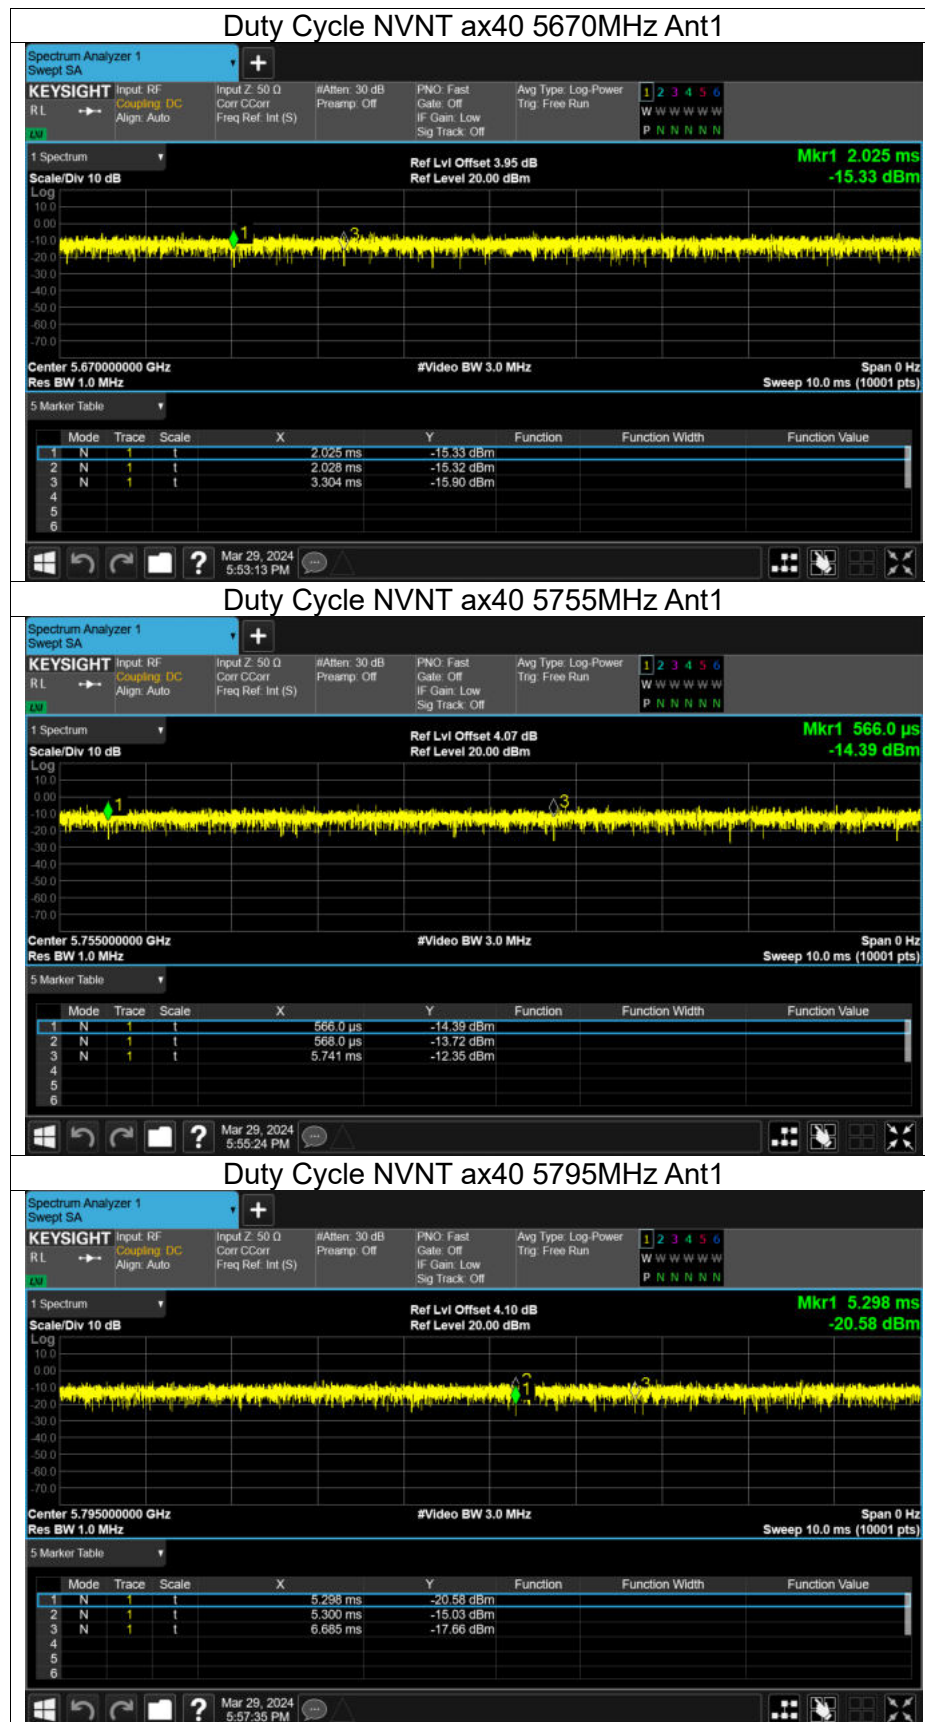


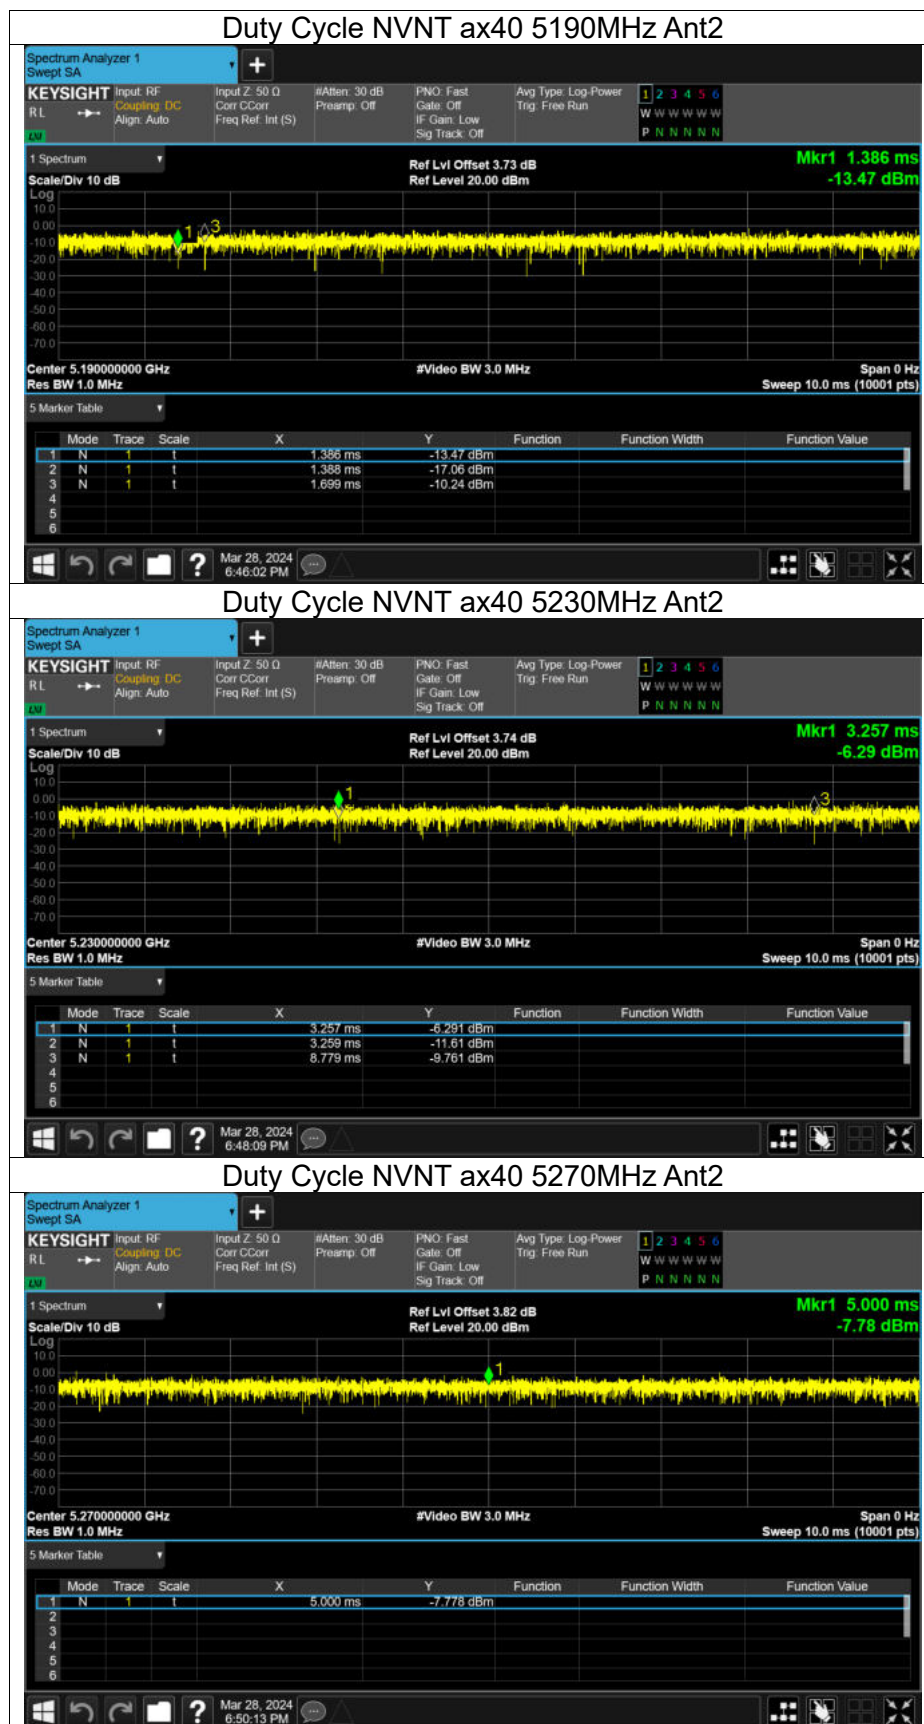


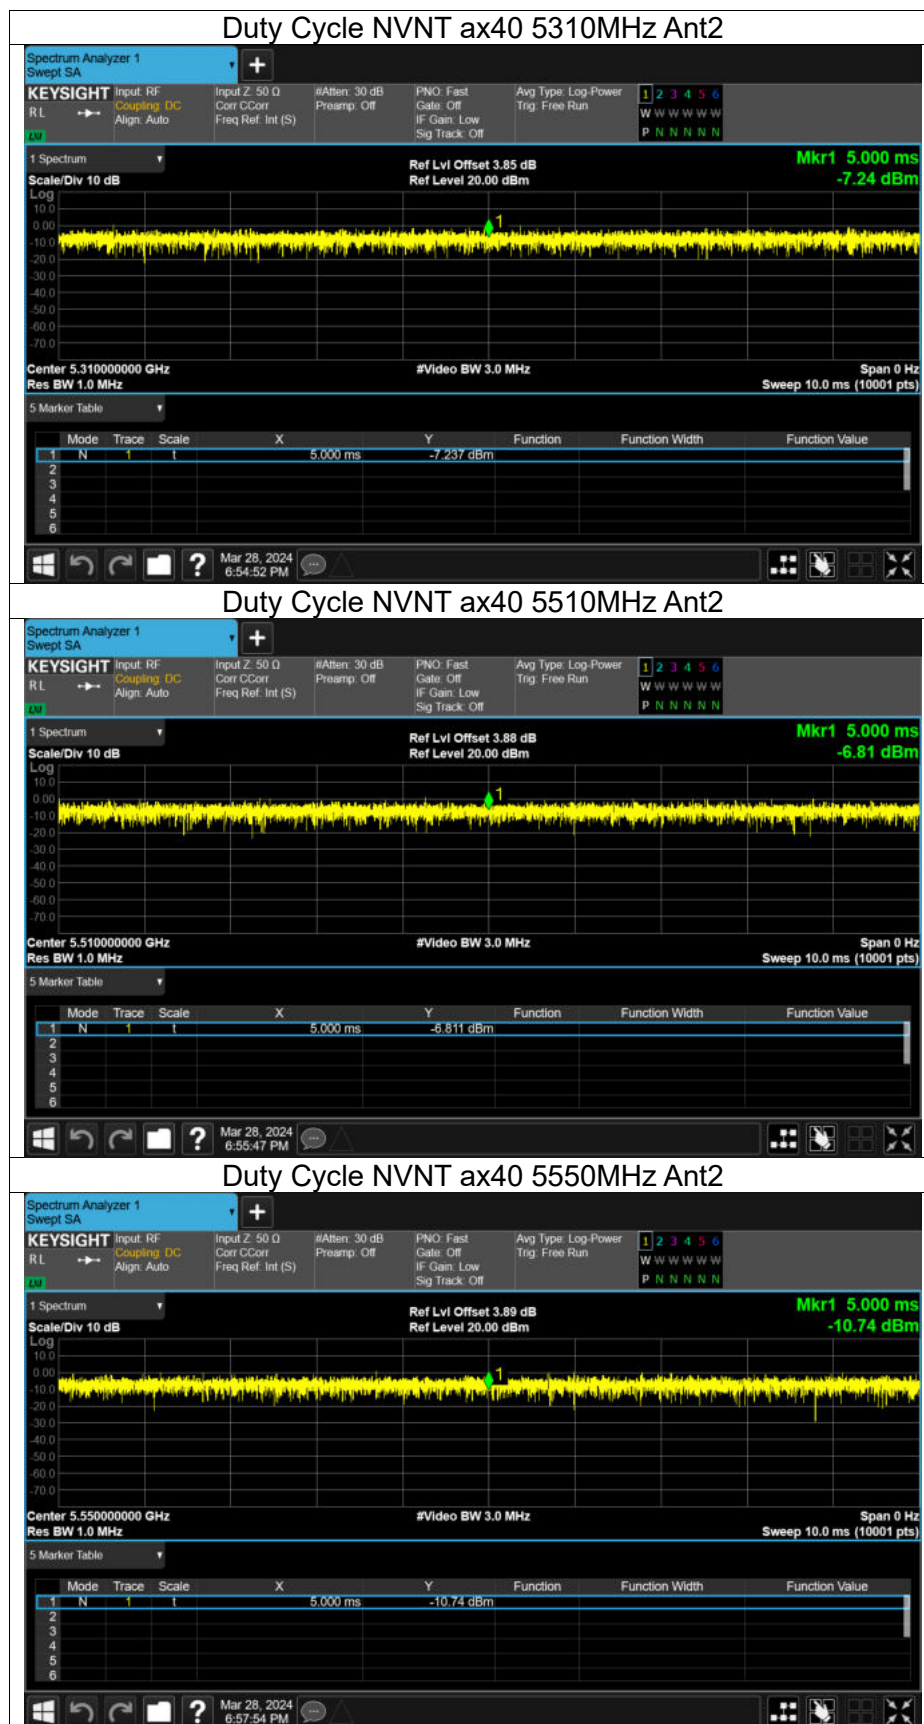


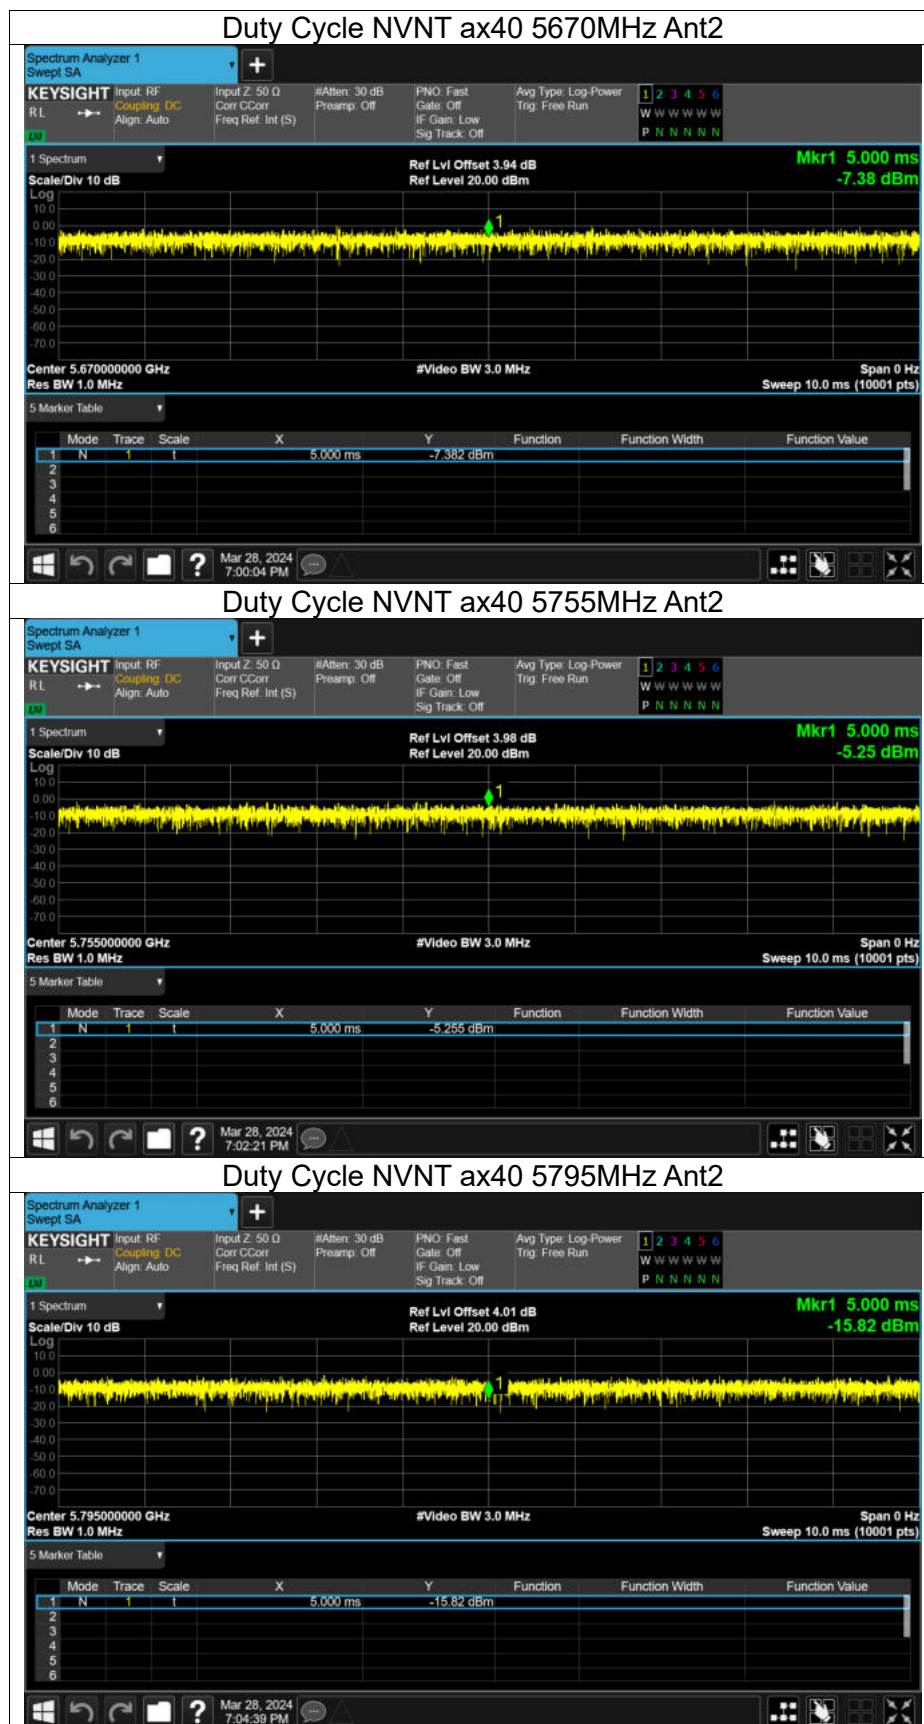


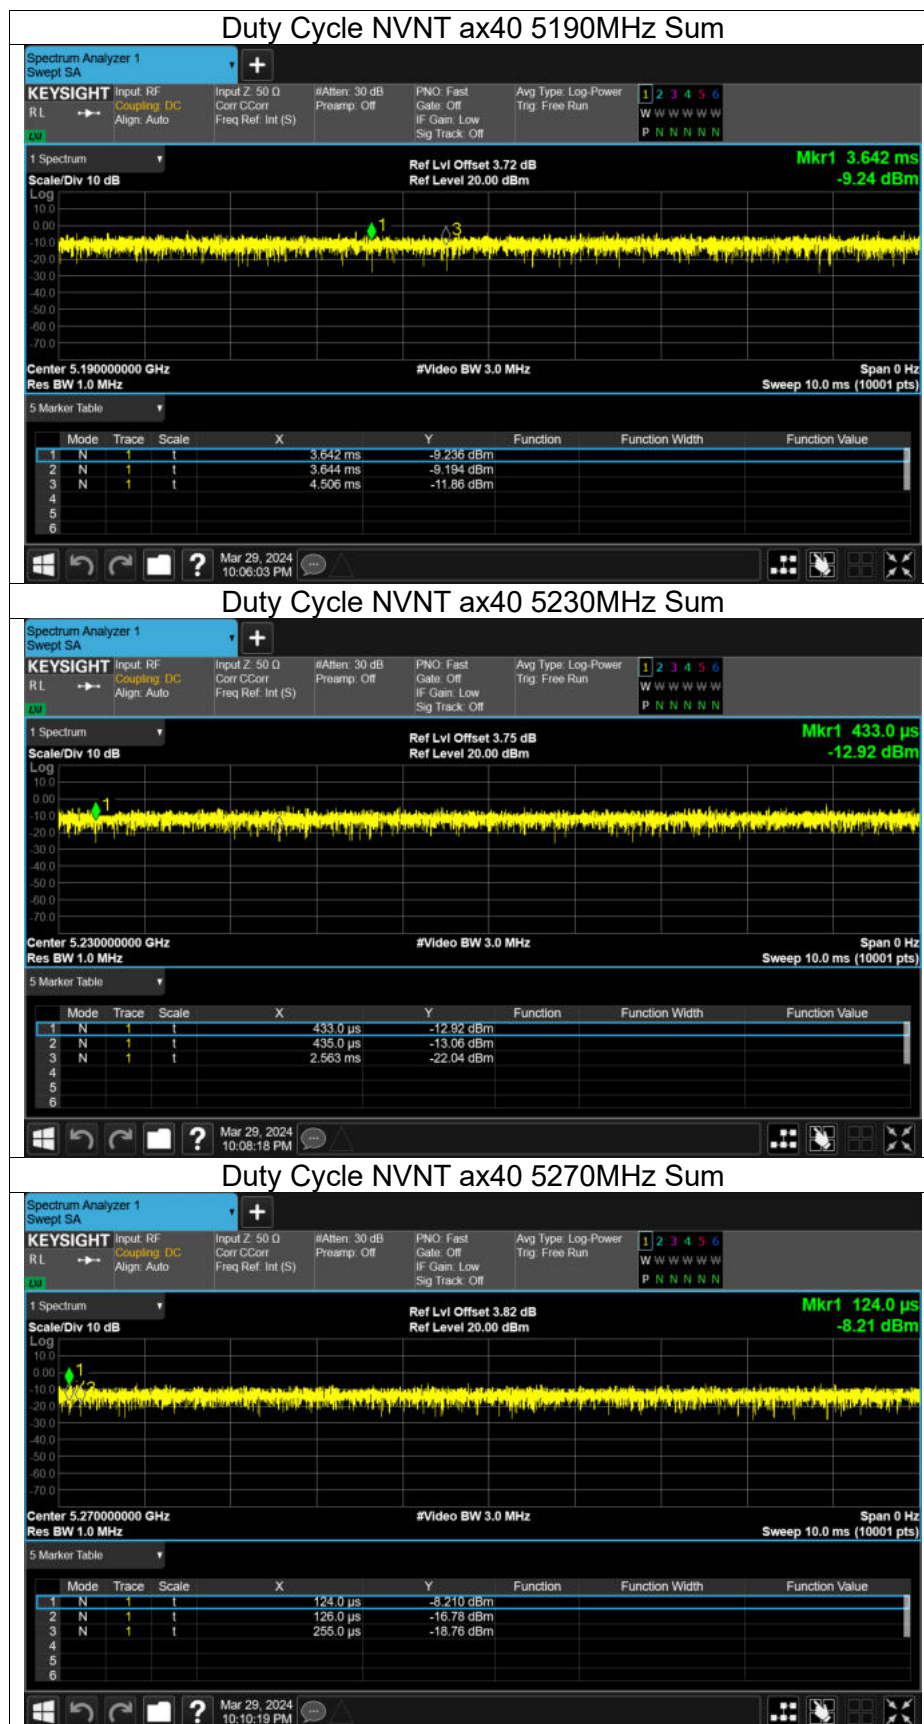


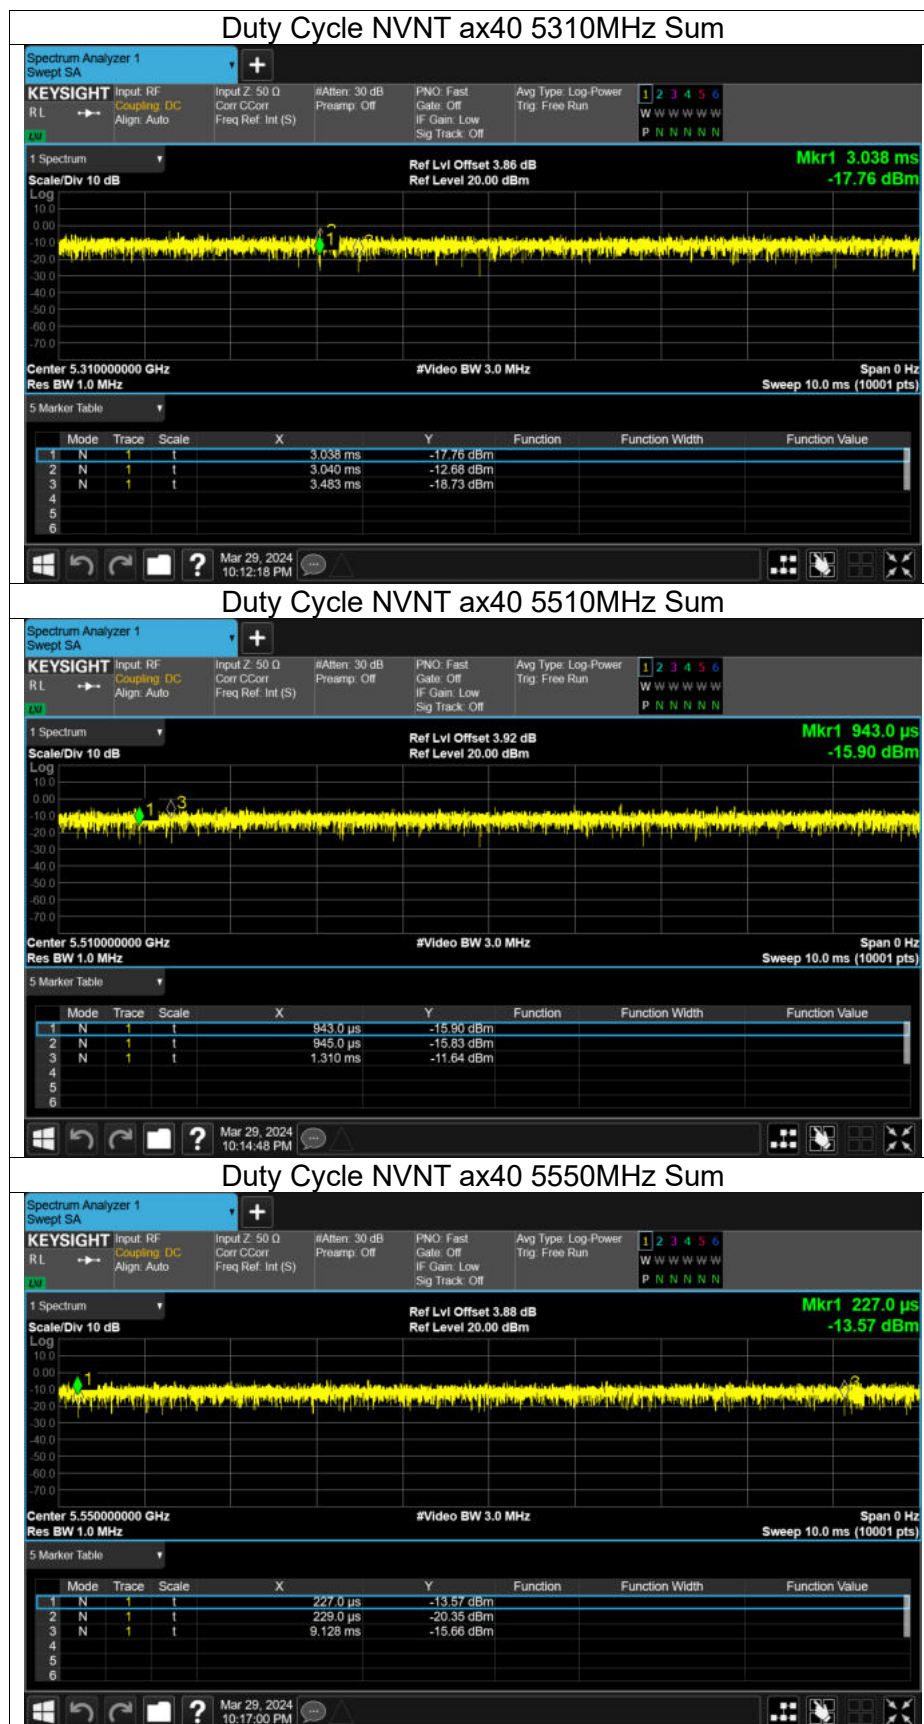


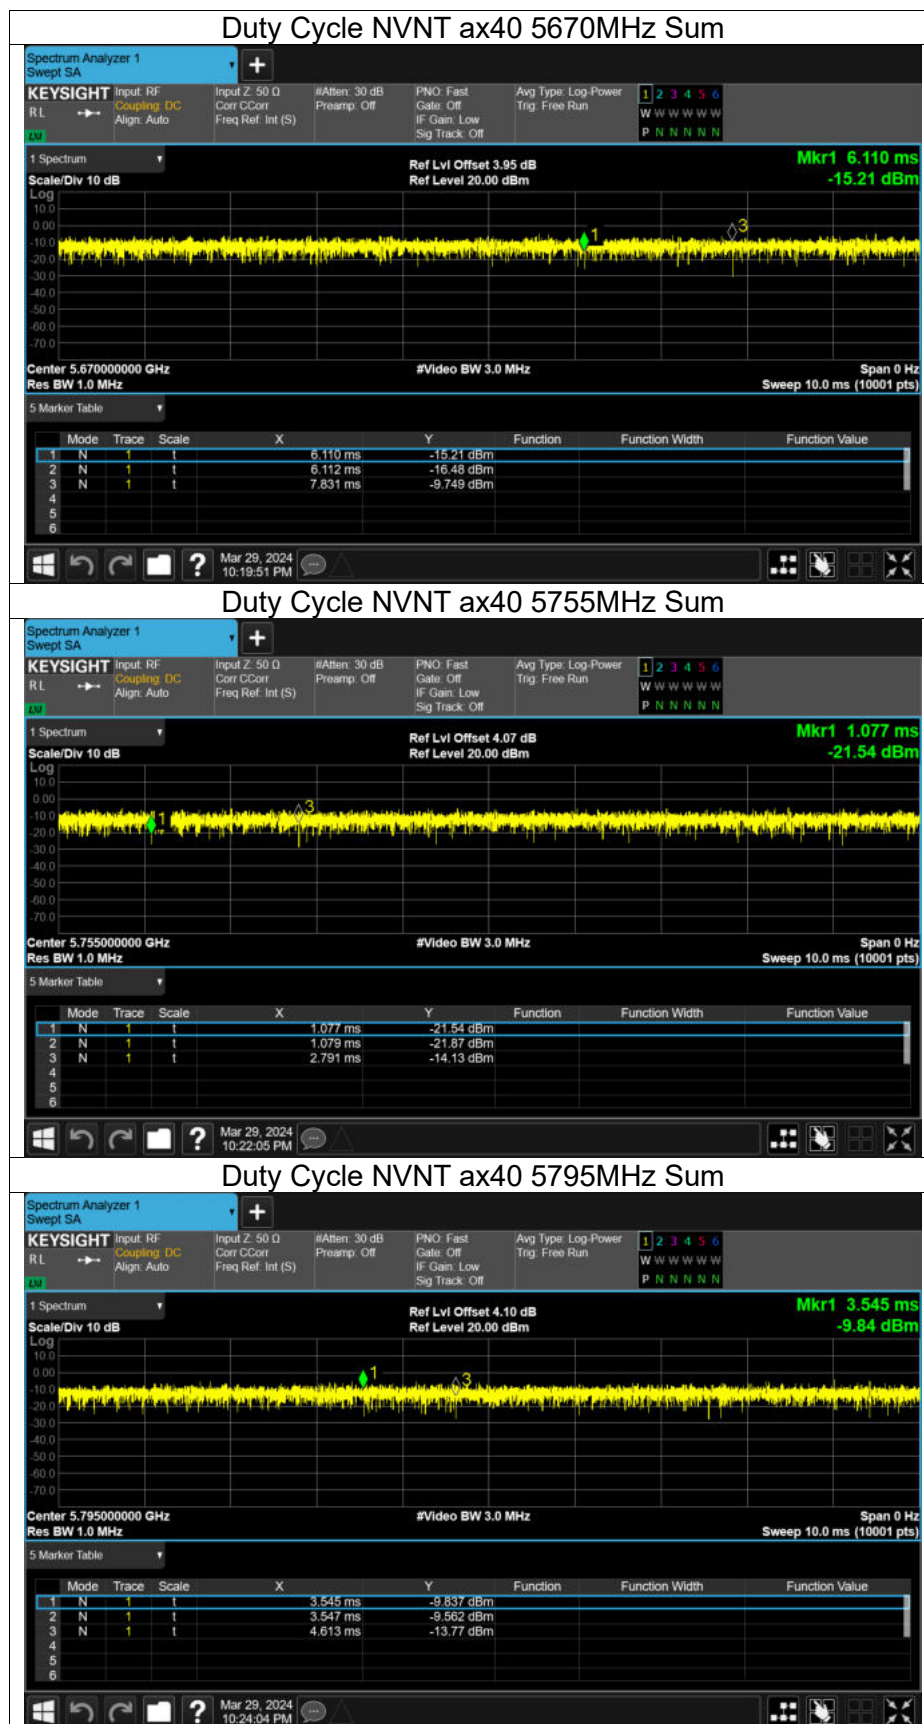


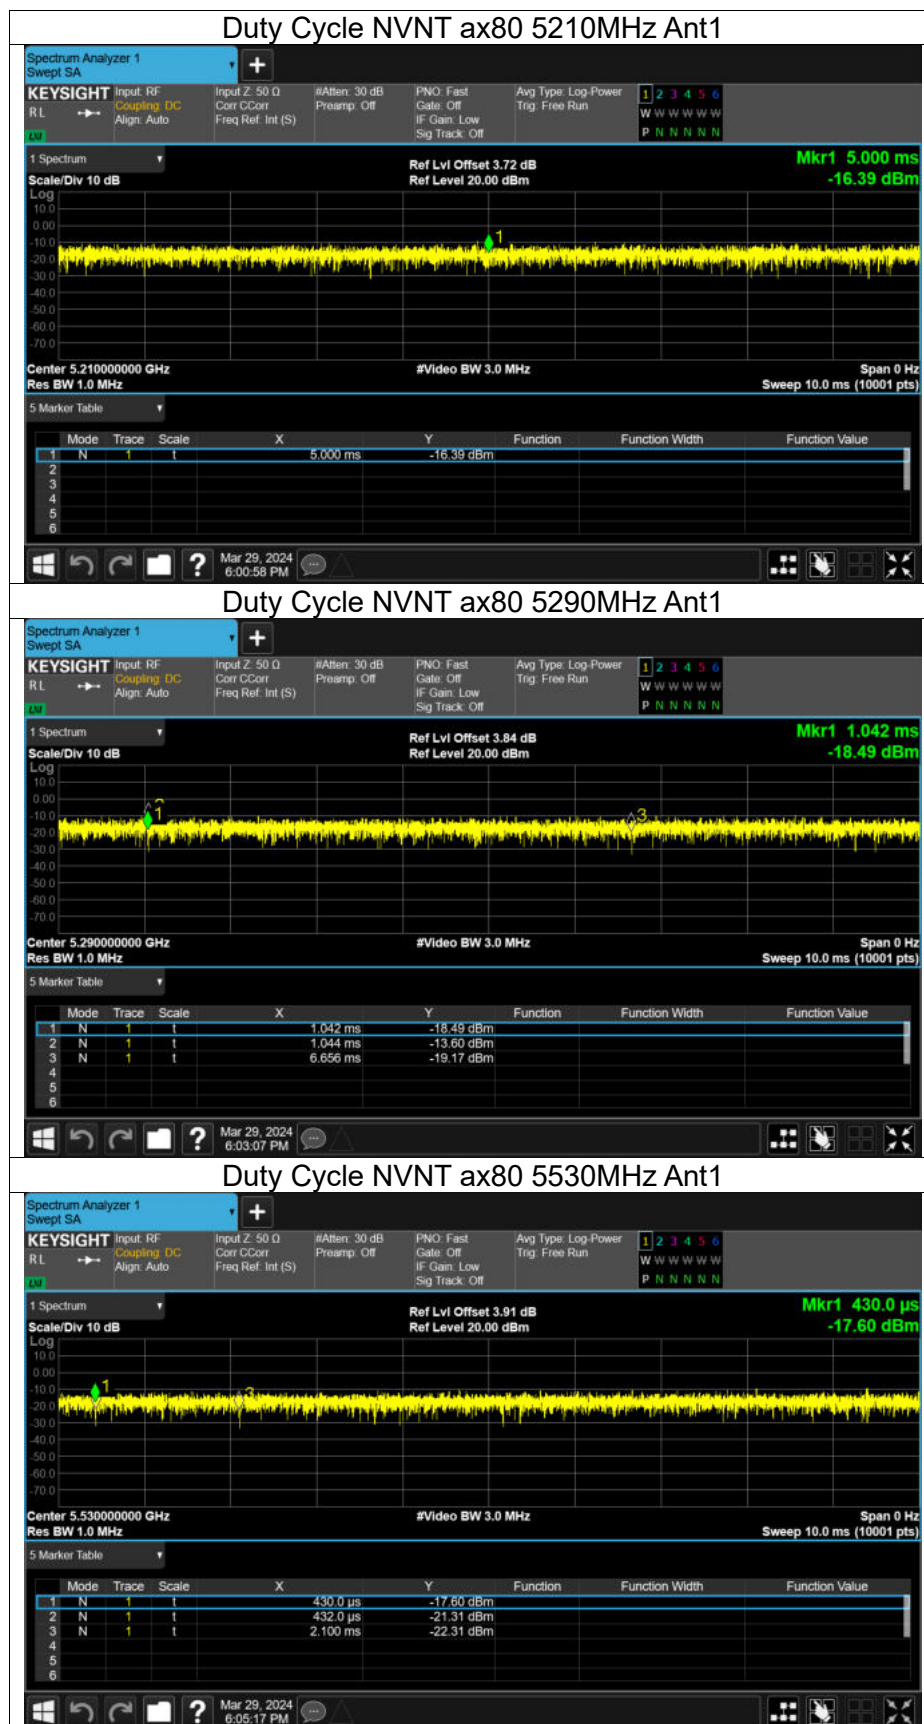

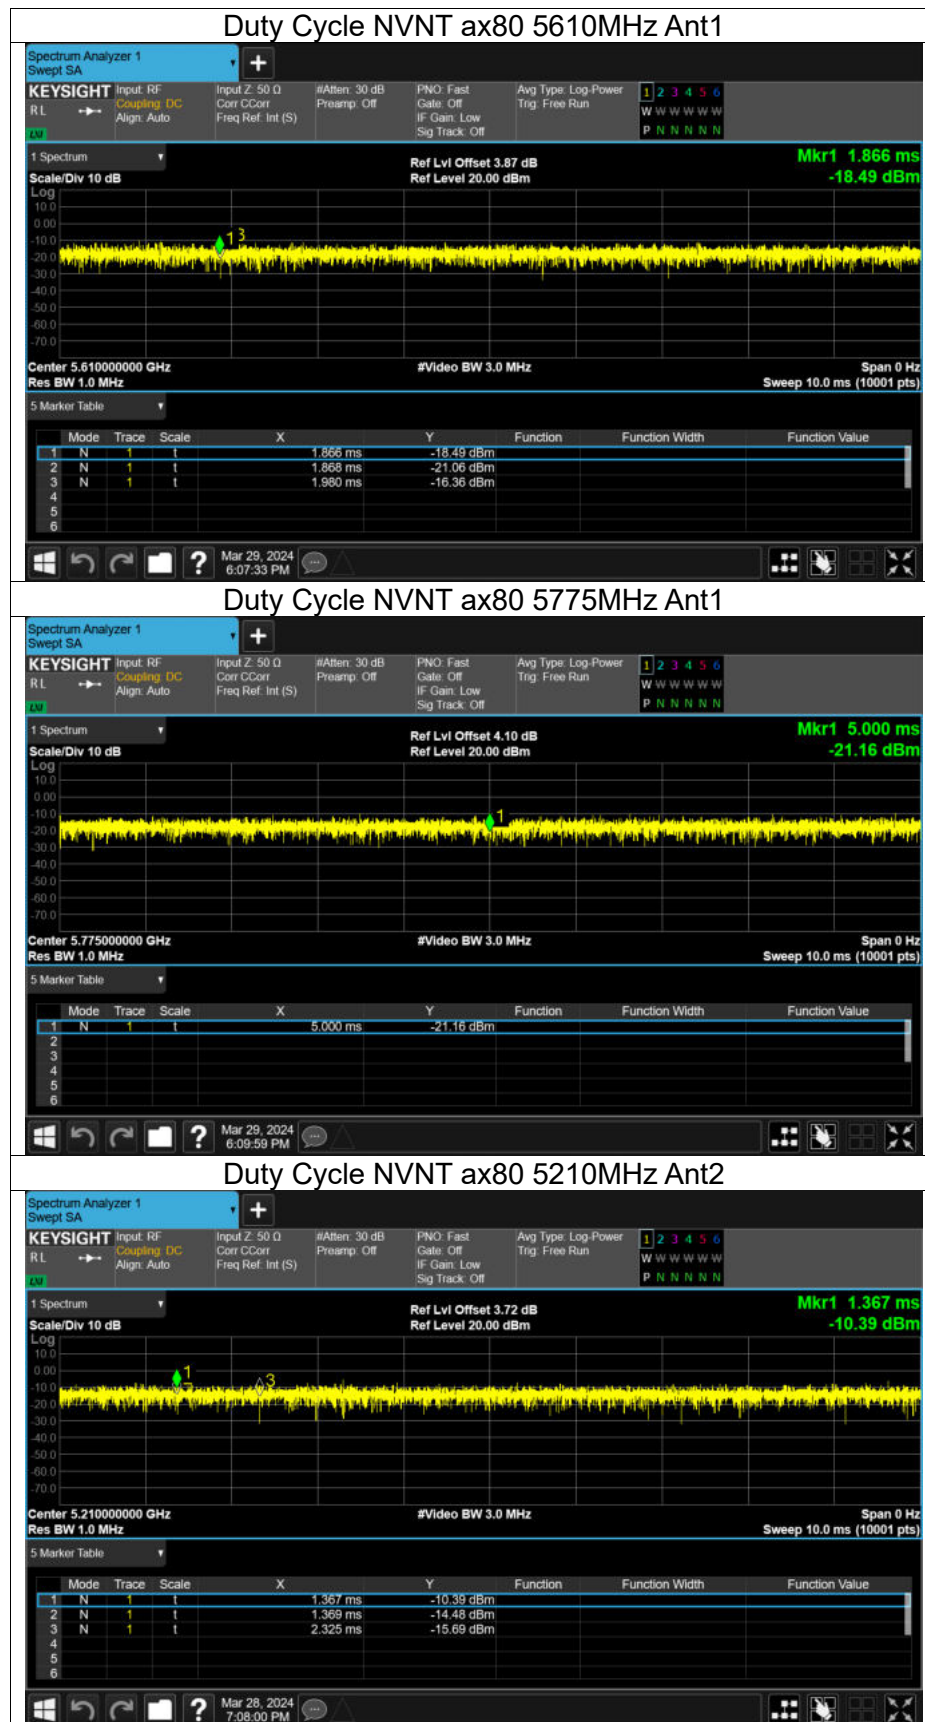

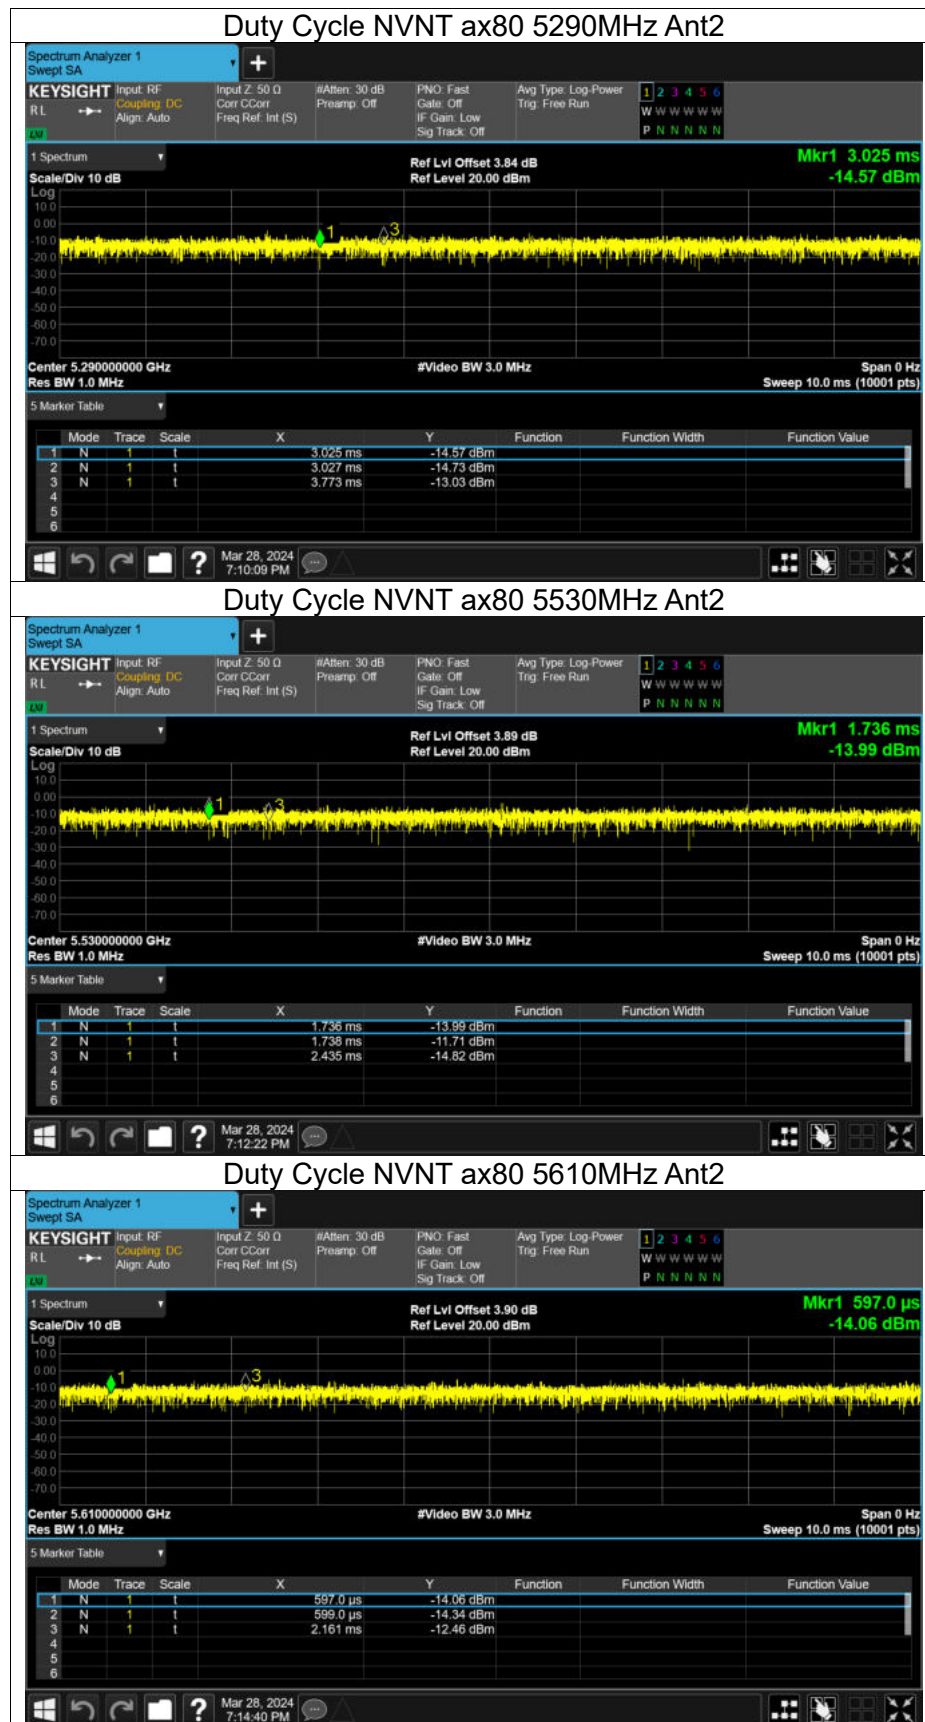

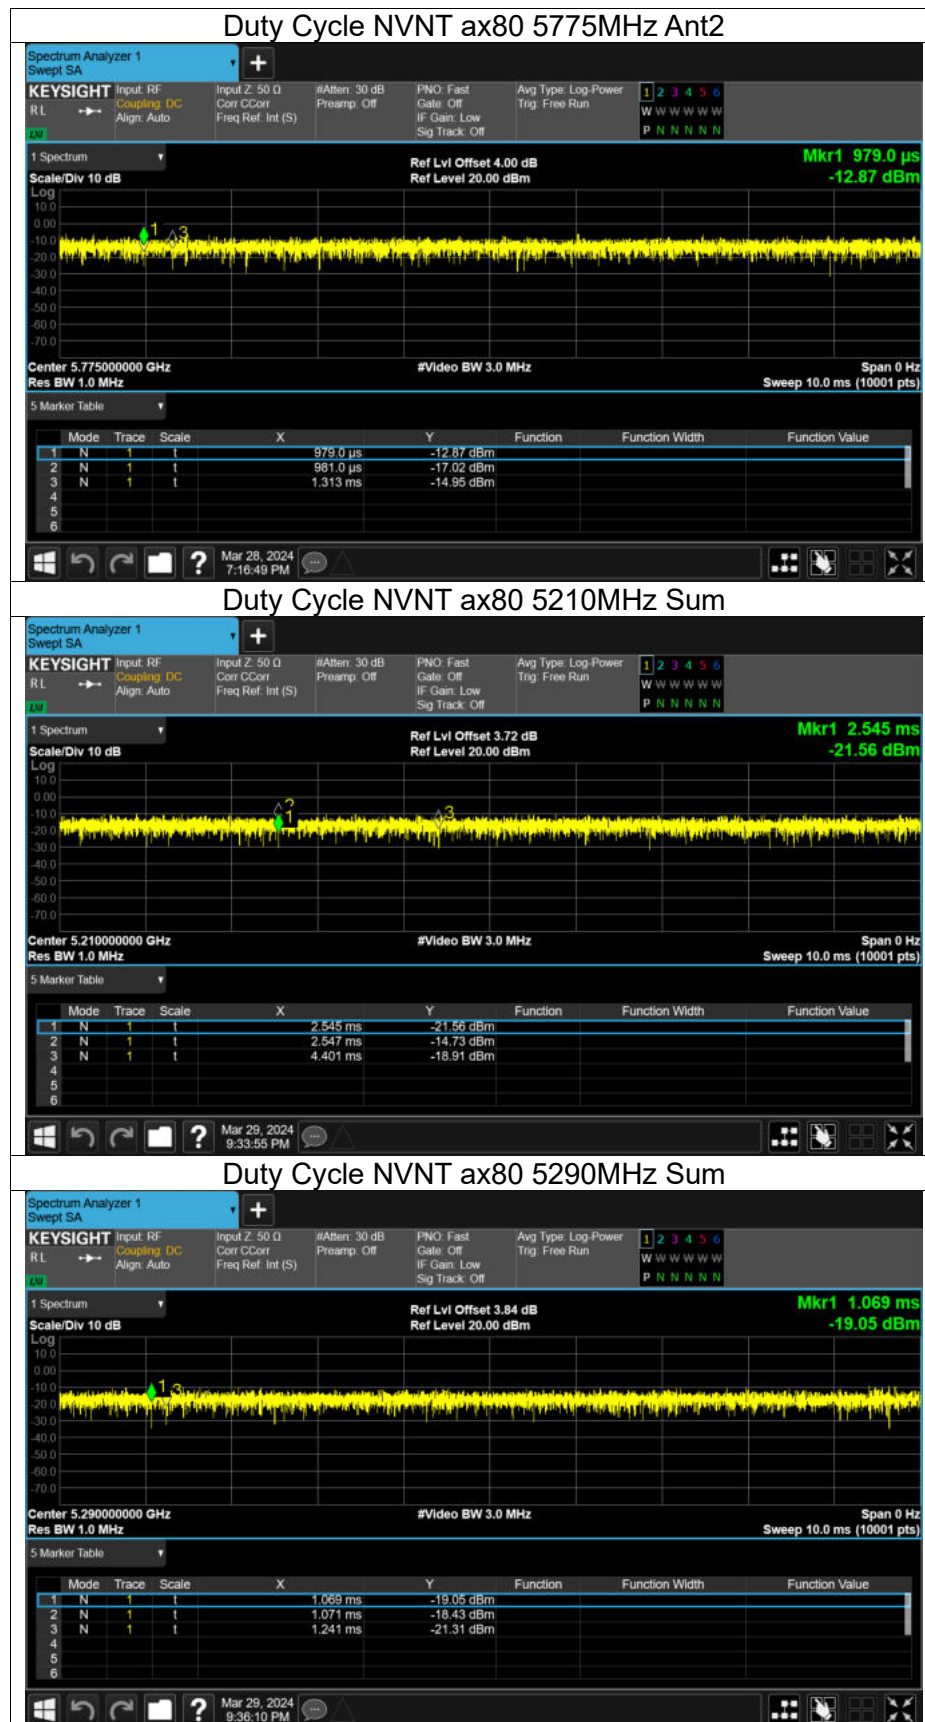

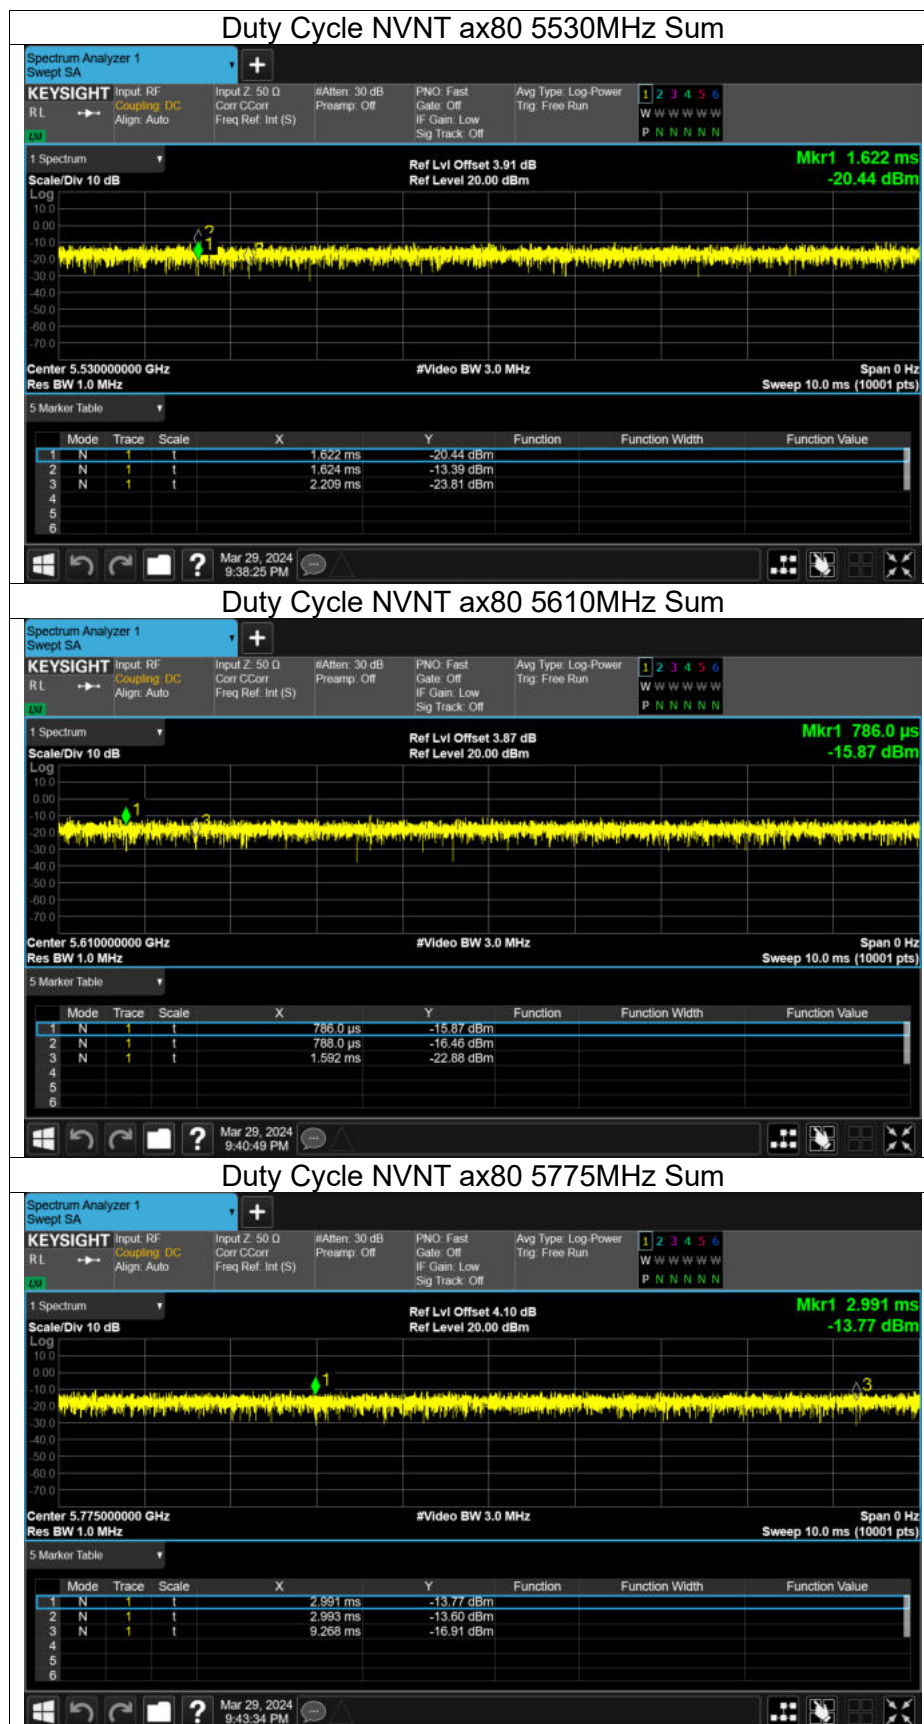



Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	6.12	0	6.12	24	Pass
NVNT	a	5200	Ant1	5.37	0	5.37	24	Pass
NVNT	a	5240	Ant1	5.04	0	5.04	24	Pass
NVNT	a	5260	Ant1	6.77	0	6.77	24	Pass
NVNT	a	5300	Ant1	6.56	0	6.56	24	Pass
NVNT	a	5320	Ant1	6.59	0	6.59	24	Pass
NVNT	a	5500	Ant1	6.22	0	6.22	24	Pass
NVNT	a	5580	Ant1	6.89	0	6.89	24	Pass
NVNT	a	5700	Ant1	7	0	7	24	Pass
NVNT	a	5745	Ant1	4.61	0	4.61	30	Pass
NVNT	a	5785	Ant1	4.86	0	4.86	30	Pass
NVNT	a	5825	Ant1	4.28	0	4.28	30	Pass
NVNT	a	5180	Ant2	6.44	0	6.44	24	Pass
NVNT	a	5200	Ant2	6.32	0	6.32	24	Pass
NVNT	a	5240	Ant2	6.34	0	6.34	24	Pass
NVNT	a	5260	Ant2	8.11	0	8.11	24	Pass
NVNT	a	5300	Ant2	8.34	0	8.34	24	Pass
NVNT	a	5320	Ant2	8.28	0	8.28	24	Pass
NVNT	a	5500	Ant2	8.9	0	8.9	24	Pass
NVNT	a	5580	Ant2	8.8	0	8.8	24	Pass
NVNT	a	5700	Ant2	8.92	0	8.92	24	Pass
NVNT	a	5745	Ant2	6.89	0	6.89	30	Pass
NVNT	a	5785	Ant2	6.73	0	6.73	30	Pass
NVNT	a	5825	Ant2	6.26	0	6.26	30	Pass
NVNT	n20	5180	Ant1	6	0	6	24	Pass
NVNT	n20	5200	Ant1	5.61	0	5.61	24	Pass
NVNT	n20	5240	Ant1	5.45	0	5.45	24	Pass
NVNT	n20	5260	Ant1	6.26	0	6.26	24	Pass
NVNT	n20	5300	Ant1	5.98	0	5.98	24	Pass
NVNT	n20	5320	Ant1	5.92	0	5.92	24	Pass
NVNT	n20	5500	Ant1	5.6	0	5.6	24	Pass
NVNT	n20	5580	Ant1	5.99	0	5.99	24	Pass
NVNT	n20	5700	Ant1	6.18	0	6.18	24	Pass
NVNT	n20	5745	Ant1	5.89	0	5.89	30	Pass
NVNT	n20	5785	Ant1	5.02	0	5.02	30	Pass
NVNT	n20	5825	Ant1	4.43	0	4.43	30	Pass
NVNT	n20	5180	Ant2	6.5	0	6.5	24	Pass
NVNT	n20	5200	Ant2	6.14	0	6.14	24	Pass
NVNT	n20	5240	Ant2	6.39	0	6.39	24	Pass
NVNT	n20	5260	Ant2	7.11	0	7.11	24	Pass
NVNT	n20	5300	Ant2	7.33	0	7.33	24	Pass
NVNT	n20	5320	Ant2	7.63	0	7.63	24	Pass
NVNT	n20	5500	Ant2	7.94	0	7.94	24	Pass
NVNT	n20	5580	Ant2	7.69	0	7.69	24	Pass
NVNT	n20	5700	Ant2	7.66	0	7.66	24	Pass
NVNT	n20	5745	Ant2	6.97	0	6.97	30	Pass
NVNT	n20	5785	Ant2	6.99	0	6.99	30	Pass
NVNT	n20	5825	Ant2	6.23	0	6.23	30	Pass
NVNT	n20	5180	Ant1	3.3	0	3.3	24	Pass
NVNT	n20	5180	Ant2	5.15	0	5.15	24	Pass
NVNT	n20	5180	Sum	7.33	0	7.33	24	Pass



NVNT	n20	5200	Ant1	4.72	0	4.72	24	Pass
NVNT	n20	5200	Ant2	4.83	0	4.83	24	Pass
NVNT	n20	5200	Sum	7.79	0	7.79	24	Pass
NVNT	n20	5240	Ant1	5.72	0	5.72	24	Pass
NVNT	n20	5240	Ant2	4.93	0	4.93	24	Pass
NVNT	n20	5240	Sum	8.35	0	8.35	24	Pass
NVNT	n20	5260	Ant1	4.09	0	4.09	24	Pass
NVNT	n20	5260	Ant2	5.9	0	5.9	24	Pass
NVNT	n20	5260	Sum	8.1	0	8.1	24	Pass
NVNT	n20	5300	Ant1	5.36	0	5.36	24	Pass
NVNT	n20	5300	Ant2	6.17	0	6.17	24	Pass
NVNT	n20	5300	Sum	8.79	0	8.79	24	Pass
NVNT	n20	5320	Ant1	6.16	0	6.16	24	Pass
NVNT	n20	5320	Ant2	5.87	0	5.87	24	Pass
NVNT	n20	5320	Sum	9.03	0	9.03	24	Pass
NVNT	n20	5500	Ant1	3.57	0	3.57	24	Pass
NVNT	n20	5500	Ant2	6.19	0	6.19	24	Pass
NVNT	n20	5500	Sum	8.08	0	8.08	24	Pass
NVNT	n20	5580	Ant1	1.7	0	1.7	24	Pass
NVNT	n20	5580	Ant2	5.46	0	5.46	24	Pass
NVNT	n20	5580	Sum	6.99	0	6.99	24	Pass
NVNT	n20	5700	Ant1	3.8	0	3.8	24	Pass
NVNT	n20	5700	Ant2	5.49	0	5.49	24	Pass
NVNT	n20	5700	Sum	7.74	0	7.74	24	Pass
NVNT	n20	5745	Ant1	3.01	0	3.01	30	Pass
NVNT	n20	5745	Ant2	4.62	0	4.62	30	Pass
NVNT	n20	5745	Sum	6.9	0	6.9	30	Pass
NVNT	n20	5785	Ant1	1.97	0	1.97	30	Pass
NVNT	n20	5785	Ant2	4.59	0	4.59	30	Pass
NVNT	n20	5785	Sum	6.48	0	6.48	30	Pass
NVNT	n20	5825	Ant1	3.37	0	3.37	30	Pass
NVNT	n20	5825	Ant2	4.06	0	4.06	30	Pass
NVNT	n20	5825	Sum	6.74	0	6.74	30	Pass
NVNT	n40	5190	Ant1	5.75	0	5.75	24	Pass
NVNT	n40	5230	Ant1	5.49	0	5.49	24	Pass
NVNT	n40	5270	Ant1	6.18	0	6.18	24	Pass
NVNT	n40	5310	Ant1	5.95	0	5.95	24	Pass
NVNT	n40	5510	Ant1	6.24	0	6.24	24	Pass
NVNT	n40	5550	Ant1	6.72	0	6.72	24	Pass
NVNT	n40	5670	Ant1	6.98	0	6.98	24	Pass
NVNT	n40	5755	Ant1	4.62	0	4.62	30	Pass
NVNT	n40	5795	Ant1	5.02	0	5.02	30	Pass
NVNT	n40	5190	Ant2	6.56	0	6.56	24	Pass
NVNT	n40	5230	Ant2	6.13	0	6.13	24	Pass
NVNT	n40	5270	Ant2	6.96	0	6.96	24	Pass
NVNT	n40	5310	Ant2	7.13	0	7.13	24	Pass
NVNT	n40	5510	Ant2	8.54	0	8.54	24	Pass
NVNT	n40	5550	Ant2	8.95	0	8.95	24	Pass
NVNT	n40	5670	Ant2	8.9	0	8.9	24	Pass
NVNT	n40	5755	Ant2	6.64	0	6.64	30	Pass
NVNT	n40	5795	Ant2	6.87	0	6.87	30	Pass
NVNT	n40	5190	Ant1	4.17	0	4.17	24	Pass
NVNT	n40	5190	Ant2	4.74	0	4.74	24	Pass
NVNT	n40	5190	Sum	7.47	0	7.47	24	Pass
NVNT	n40	5230	Ant1	4.27	0	4.27	24	Pass
NVNT	n40	5230	Ant2	3.06	0	3.06	24	Pass



NVNT	n40	5230	Sum	6.72	0	6.72	24	Pass
NVNT	n40	5270	Ant1	1.95	0	1.95	24	Pass
NVNT	n40	5270	Ant2	6.09	0	6.09	24	Pass
NVNT	n40	5270	Sum	7.51	0	7.51	24	Pass
NVNT	n40	5310	Ant1	5.57	0	5.57	24	Pass
NVNT	n40	5310	Ant2	5.77	0	5.77	24	Pass
NVNT	n40	5310	Sum	8.68	0	8.68	24	Pass
NVNT	n40	5510	Ant1	5.07	0	5.07	24	Pass
NVNT	n40	5510	Ant2	6.08	0	6.08	24	Pass
NVNT	n40	5510	Sum	8.61	0	8.61	24	Pass
NVNT	n40	5550	Ant1	4.38	0	4.38	24	Pass
NVNT	n40	5550	Ant2	6.4	0	6.4	24	Pass
NVNT	n40	5550	Sum	8.52	0	8.52	24	Pass
NVNT	n40	5670	Ant1	3.99	0	3.99	24	Pass
NVNT	n40	5670	Ant2	6.44	0	6.44	24	Pass
NVNT	n40	5670	Sum	8.4	0	8.4	24	Pass
NVNT	n40	5755	Ant1	4.05	0	4.05	30	Pass
NVNT	n40	5755	Ant2	6.14	0	6.14	30	Pass
NVNT	n40	5755	Sum	8.23	0	8.23	30	Pass
NVNT	n40	5795	Ant1	4.8	0	4.8	30	Pass
NVNT	n40	5795	Ant2	5.83	0	5.83	30	Pass
NVNT	n40	5795	Sum	8.36	0	8.36	30	Pass
NVNT	ac20	5180	Ant1	6.88	0	6.88	24	Pass
NVNT	ac20	5200	Ant1	6.86	0	6.86	24	Pass
NVNT	ac20	5240	Ant1	6.4	0	6.4	24	Pass
NVNT	ac20	5260	Ant1	7.15	0	7.15	24	Pass
NVNT	ac20	5300	Ant1	6.79	0	6.79	24	Pass
NVNT	ac20	5320	Ant1	6.99	0	6.99	24	Pass
NVNT	ac20	5500	Ant1	6.7	0	6.7	24	Pass
NVNT	ac20	5580	Ant1	6.97	0	6.97	24	Pass
NVNT	ac20	5700	Ant1	7.27	0	7.27	24	Pass
NVNT	ac20	5745	Ant1	5.74	0	5.74	30	Pass
NVNT	ac20	5785	Ant1	5.99	0	5.99	30	Pass
NVNT	ac20	5825	Ant1	5.37	0	5.37	30	Pass
NVNT	ac20	5180	Ant2	7.45	0	7.45	24	Pass
NVNT	ac20	5200	Ant2	6.95	0	6.95	24	Pass
NVNT	ac20	5240	Ant2	7.72	0	7.72	24	Pass
NVNT	ac20	5260	Ant2	8.44	0	8.44	24	Pass
NVNT	ac20	5300	Ant2	8.2	0	8.2	24	Pass
NVNT	ac20	5320	Ant2	8.72	0	8.72	24	Pass
NVNT	ac20	5500	Ant2	9.05	0	9.05	24	Pass
NVNT	ac20	5580	Ant2	9.23	0	9.23	24	Pass
NVNT	ac20	5700	Ant2	8.74	0	8.74	24	Pass
NVNT	ac20	5745	Ant2	8.05	0	8.05	30	Pass
NVNT	ac20	5785	Ant2	7.59	0	7.59	30	Pass
NVNT	ac20	5825	Ant2	7.19	0	7.19	30	Pass
NVNT	ac20	5180	Ant1	2.94	0	2.94	24	Pass
NVNT	ac20	5180	Ant2	4.88	0	4.88	24	Pass
NVNT	ac20	5180	Sum	7.03	0	7.03	24	Pass
NVNT	ac20	5200	Ant1	4.78	0	4.78	24	Pass
NVNT	ac20	5200	Ant2	4.69	0	4.69	24	Pass
NVNT	ac20	5200	Sum	7.75	0	7.75	24	Pass
NVNT	ac20	5240	Ant1	5.61	0	5.61	24	Pass
NVNT	ac20	5240	Ant2	5.18	0	5.18	24	Pass
NVNT	ac20	5240	Sum	8.41	0	8.41	24	Pass
NVNT	ac20	5260	Ant1	3.89	0	3.89	24	Pass



NVNT	ac20	5260	Ant2	5.65	0	5.65	24	Pass
NVNT	ac20	5260	Sum	7.87	0	7.87	24	Pass
NVNT	ac20	5300	Ant1	5.01	0	5.01	24	Pass
NVNT	ac20	5300	Ant2	5.74	0	5.74	24	Pass
NVNT	ac20	5300	Sum	8.4	0	8.4	24	Pass
NVNT	ac20	5320	Ant1	5.91	0	5.91	24	Pass
NVNT	ac20	5320	Ant2	5.71	0	5.71	24	Pass
NVNT	ac20	5320	Sum	8.82	0	8.82	24	Pass
NVNT	ac20	5500	Ant1	4.82	0	4.82	24	Pass
NVNT	ac20	5500	Ant2	6.7	0	6.7	24	Pass
NVNT	ac20	5500	Sum	8.87	0	8.87	24	Pass
NVNT	ac20	5580	Ant1	4.04	0	4.04	24	Pass
NVNT	ac20	5580	Ant2	6.77	0	6.77	24	Pass
NVNT	ac20	5580	Sum	8.63	0	8.63	24	Pass
NVNT	ac20	5700	Ant1	5.37	0	5.37	24	Pass
NVNT	ac20	5700	Ant2	6.43	0	6.43	24	Pass
NVNT	ac20	5700	Sum	8.94	0	8.94	24	Pass
NVNT	ac20	5745	Ant1	5.26	0	5.26	30	Pass
NVNT	ac20	5745	Ant2	6.53	0	6.53	30	Pass
NVNT	ac20	5745	Sum	8.95	0	8.95	30	Pass
NVNT	ac20	5785	Ant1	4.58	0	4.58	30	Pass
NVNT	ac20	5785	Ant2	6.31	0	6.31	30	Pass
NVNT	ac20	5785	Sum	8.54	0	8.54	30	Pass
NVNT	ac20	5825	Ant1	4.91	0	4.91	30	Pass
NVNT	ac20	5825	Ant2	5.4	0	5.4	30	Pass
NVNT	ac20	5825	Sum	8.17	0	8.17	30	Pass
NVNT	ac40	5180	Ant1	0.73	0	0.73	24	Pass
NVNT	ac40	5190	Ant1	6.78	0	6.78	24	Pass
NVNT	ac40	5230	Ant1	6.22	0	6.22	24	Pass
NVNT	ac40	5270	Ant1	7.24	0	7.24	24	Pass
NVNT	ac40	5310	Ant1	6.53	0	6.53	24	Pass
NVNT	ac40	5510	Ant1	6.27	0	6.27	24	Pass
NVNT	ac40	5550	Ant1	6.77	0	6.77	24	Pass
NVNT	ac40	5670	Ant1	6.89	0	6.89	24	Pass
NVNT	ac40	5755	Ant1	6.66	0	6.66	30	Pass
NVNT	ac40	5795	Ant1	6.95	0	6.95	30	Pass
NVNT	ac40	5190	Ant2	7.17	0	7.17	24	Pass
NVNT	ac40	5230	Ant2	7.27	0	7.27	24	Pass
NVNT	ac40	5270	Ant2	8.08	0	8.08	24	Pass
NVNT	ac40	5310	Ant2	8.32	0	8.32	24	Pass
NVNT	ac40	5510	Ant2	8.97	0	8.97	24	Pass
NVNT	ac40	5550	Ant2	9.18	0	9.18	24	Pass
NVNT	ac40	5670	Ant2	9.15	0	9.15	24	Pass
NVNT	ac40	5755	Ant2	8.94	0	8.94	30	Pass
NVNT	ac40	5795	Ant2	8.57	0	8.57	30	Pass
NVNT	ac40	5190	Ant1	4.16	0	4.16	24	Pass
NVNT	ac40	5190	Ant2	4.79	0	4.79	24	Pass
NVNT	ac40	5190	Sum	7.5	0	7.5	24	Pass
NVNT	ac40	5230	Ant1	6.16	0	6.16	24	Pass
NVNT	ac40	5230	Ant2	4.82	0	4.82	24	Pass
NVNT	ac40	5230	Sum	8.55	0	8.55	24	Pass
NVNT	ac40	5270	Ant1	3.52	0	3.52	24	Pass
NVNT	ac40	5270	Ant2	5.75	0	5.75	24	Pass
NVNT	ac40	5270	Sum	7.79	0	7.79	24	Pass
NVNT	ac40	5310	Ant1	5.6	0	5.6	24	Pass
NVNT	ac40	5310	Ant2	5.84	0	5.84	24	Pass



NVNT	ac40	5310	Sum	8.73	0	8.73	24	Pass
NVNT	ac40	5510	Ant1	5.33	0	5.33	24	Pass
NVNT	ac40	5510	Ant2	6.42	0	6.42	24	Pass
NVNT	ac40	5510	Sum	8.92	0	8.92	24	Pass
NVNT	ac40	5550	Ant1	4.46	0	4.46	24	Pass
NVNT	ac40	5550	Ant2	6.61	0	6.61	24	Pass
NVNT	ac40	5550	Sum	8.68	0	8.68	24	Pass
NVNT	ac40	5670	Ant1	3.88	0	3.88	24	Pass
NVNT	ac40	5670	Ant2	6.62	0	6.62	24	Pass
NVNT	ac40	5670	Sum	8.47	0	8.47	24	Pass
NVNT	ac40	5755	Ant1	4.46	0	4.46	30	Pass
NVNT	ac40	5755	Ant2	6.12	0	6.12	30	Pass
NVNT	ac40	5755	Sum	8.38	0	8.38	30	Pass
NVNT	ac40	5795	Ant1	5.01	0	5.01	30	Pass
NVNT	ac40	5795	Ant2	6.1	0	6.1	30	Pass
NVNT	ac40	5795	Sum	8.6	0	8.6	30	Pass
NVNT	ac80	5210	Ant1	6.13	0	6.13	24	Pass
NVNT	ac80	5290	Ant1	6.85	0	6.85	24	Pass
NVNT	ac80	5530	Ant1	6.45	0	6.45	24	Pass
NVNT	ac80	5610	Ant1	6.45	0	6.45	24	Pass
NVNT	ac80	5775	Ant1	6.59	0	6.59	30	Pass
NVNT	ac80	5210	Ant2	7.11	0	7.11	24	Pass
NVNT	ac80	5290	Ant2	8.17	0	8.17	24	Pass
NVNT	ac80	5530	Ant2	8.46	0	8.46	24	Pass
NVNT	ac80	5610	Ant2	8.16	0	8.16	24	Pass
NVNT	ac80	5775	Ant2	7.77	0	7.77	30	Pass
NVNT	ac80	5210	Ant1	4.64	0	4.64	24	Pass
NVNT	ac80	5210	Ant2	4.38	0	4.38	24	Pass
NVNT	ac80	5210	Sum	7.52	0	7.52	24	Pass
NVNT	ac80	5290	Ant1	4.88	0	4.88	24	Pass
NVNT	ac80	5290	Ant2	5.52	0	5.52	24	Pass
NVNT	ac80	5290	Sum	8.22	0	8.22	24	Pass
NVNT	ac80	5530	Ant1	4.96	0	4.96	24	Pass
NVNT	ac80	5530	Ant2	6.34	0	6.34	24	Pass
NVNT	ac80	5530	Sum	8.71	0	8.71	24	Pass
NVNT	ac80	5610	Ant1	4.81	0	4.81	24	Pass
NVNT	ac80	5610	Ant2	6.25	0	6.25	24	Pass
NVNT	ac80	5610	Sum	8.6	0	8.6	24	Pass
NVNT	ac80	5775	Ant1	4.19	0	4.19	30	Pass
NVNT	ac80	5775	Ant2	5.79	0	5.79	30	Pass
NVNT	ac80	5775	Sum	8.07	0	8.07	30	Pass
NVNT	ax20	5180	Ant1	5.9	0	5.9	24	Pass
NVNT	ax20	5200	Ant1	5.77	0	5.77	24	Pass
NVNT	ax20	5240	Ant1	5.45	0	5.45	24	Pass
NVNT	ax20	5260	Ant1	6.89	0	6.89	24	Pass
NVNT	ax20	5300	Ant1	6.53	0	6.53	24	Pass
NVNT	ax20	5320	Ant1	6.43	0	6.43	24	Pass
NVNT	ax20	5500	Ant1	6.12	0	6.12	24	Pass
NVNT	ax20	5580	Ant1	6.81	0	6.81	24	Pass
NVNT	ax20	5700	Ant1	6.71	0	6.71	24	Pass
NVNT	ax20	5745	Ant1	6.44	0	6.44	30	Pass
NVNT	ax20	5785	Ant1	6.7	0	6.7	30	Pass
NVNT	ax20	5825	Ant1	6	0	6	30	Pass
NVNT	ax20	5180	Ant2	7.17	0	7.17	24	Pass
NVNT	ax20	5200	Ant2	7.76	0	7.76	24	Pass
NVNT	ax20	5240	Ant2	7.95	0	7.95	24	Pass



NVNT	ax20	5260	Ant2	8.67	0	8.67	24	Pass
NVNT	ax20	5300	Ant2	8.83	0	8.83	24	Pass
NVNT	ax20	5320	Ant2	8.87	0	8.87	24	Pass
NVNT	ax20	5500	Ant2	9.12	0	9.12	24	Pass
NVNT	ax20	5580	Ant2	8.85	0	8.85	24	Pass
NVNT	ax20	5700	Ant2	7.89	0	7.89	24	Pass
NVNT	ax20	5745	Ant2	8.33	0	8.33	30	Pass
NVNT	ax20	5785	Ant2	8.18	0	8.18	30	Pass
NVNT	ax20	5825	Ant2	7.49	0	7.49	30	Pass
NVNT	ax20	5180	Ant1	3.22	0	3.22	24	Pass
NVNT	ax20	5180	Ant2	5.21	0	5.21	24	Pass
NVNT	ax20	5180	Sum	7.34	0	7.34	24	Pass
NVNT	ax20	5200	Ant1	5.23	0	5.23	24	Pass
NVNT	ax20	5200	Ant2	4.78	0	4.78	24	Pass
NVNT	ax20	5200	Sum	8.02	0	8.02	24	Pass
NVNT	ax20	5240	Ant1	5.74	0	5.74	24	Pass
NVNT	ax20	5240	Ant2	5.24	0	5.24	24	Pass
NVNT	ax20	5240	Sum	8.51	0	8.51	24	Pass
NVNT	ax20	5260	Ant1	4.18	0	4.18	24	Pass
NVNT	ax20	5260	Ant2	6	0	6	24	Pass
NVNT	ax20	5260	Sum	8.19	0	8.19	24	Pass
NVNT	ax20	5300	Ant1	5.09	0	5.09	24	Pass
NVNT	ax20	5300	Ant2	5.98	0	5.98	24	Pass
NVNT	ax20	5300	Sum	8.57	0	8.57	24	Pass
NVNT	ax20	5320	Ant1	6.4	0	6.4	24	Pass
NVNT	ax20	5320	Ant2	6.22	0	6.22	24	Pass
NVNT	ax20	5320	Sum	9.32	0	9.32	24	Pass
NVNT	ax20	5500	Ant1	5.02	0	5.02	24	Pass
NVNT	ax20	5500	Ant2	6.88	0	6.88	24	Pass
NVNT	ax20	5500	Sum	9.06	0	9.06	24	Pass
NVNT	ax20	5580	Ant1	3.79	0	3.79	24	Pass
NVNT	ax20	5580	Ant2	6.84	0	6.84	24	Pass
NVNT	ax20	5580	Sum	8.59	0	8.59	24	Pass
NVNT	ax20	5700	Ant1	3.83	0	3.83	24	Pass
NVNT	ax20	5700	Ant2	5.94	0	5.94	24	Pass
NVNT	ax20	5700	Sum	8.02	0	8.02	24	Pass
NVNT	ax20	5745	Ant1	3.82	0	3.82	30	Pass
NVNT	ax20	5745	Ant2	5.77	0	5.77	30	Pass
NVNT	ax20	5745	Sum	7.91	0	7.91	30	Pass
NVNT	ax20	5785	Ant1	2.9	0	2.9	30	Pass
NVNT	ax20	5785	Ant2	5.8	0	5.8	30	Pass
NVNT	ax20	5785	Sum	7.6	0	7.6	30	Pass
NVNT	ax20	5825	Ant1	4.26	0	4.26	30	Pass
NVNT	ax20	5825	Ant2	5.03	0	5.03	30	Pass
NVNT	ax20	5825	Sum	7.67	0	7.67	30	Pass
NVNT	ax40	5190	Ant1	5.96	0	5.96	24	Pass
NVNT	ax40	5230	Ant1	5.77	0	5.77	24	Pass
NVNT	ax40	5270	Ant1	7.56	0	7.56	24	Pass
NVNT	ax40	5310	Ant1	6.11	0	6.11	24	Pass
NVNT	ax40	5510	Ant1	5.33	0	5.33	24	Pass
NVNT	ax40	5550	Ant1	5.59	0	5.59	24	Pass
NVNT	ax40	5670	Ant1	6.07	0	6.07	24	Pass
NVNT	ax40	5755	Ant1	5.91	0	5.91	30	Pass
NVNT	ax40	5795	Ant1	6.35	0	6.35	30	Pass
NVNT	ax40	5190	Ant2	7.13	0	7.13	24	Pass
NVNT	ax40	5230	Ant2	6.99	0	6.99	24	Pass



NVNT	ax40	5270	Ant2	8.69	0	8.69	24	Pass
NVNT	ax40	5310	Ant2	8.8	0	8.8	24	Pass
NVNT	ax40	5510	Ant2	8.64	0	8.64	24	Pass
NVNT	ax40	5550	Ant2	8.93	0	8.93	24	Pass
NVNT	ax40	5670	Ant2	8.83	0	8.83	24	Pass
NVNT	ax40	5755	Ant2	8.33	0	8.33	30	Pass
NVNT	ax40	5795	Ant2	8.08	0	8.08	30	Pass
NVNT	ax40	5190	Ant1	4.28	0	4.28	24	Pass
NVNT	ax40	5190	Ant2	4.8	0	4.8	24	Pass
NVNT	ax40	5190	Sum	7.56	0	7.56	24	Pass
NVNT	ax40	5230	Ant1	6.16	0	6.16	24	Pass
NVNT	ax40	5230	Ant2	4.71	0	4.71	24	Pass
NVNT	ax40	5230	Sum	8.51	0	8.51	24	Pass
NVNT	ax40	5270	Ant1	3.76	0	3.76	24	Pass
NVNT	ax40	5270	Ant2	6.16	0	6.16	24	Pass
NVNT	ax40	5270	Sum	8.13	0	8.13	24	Pass
NVNT	ax40	5310	Ant1	5.92	0	5.92	24	Pass
NVNT	ax40	5310	Ant2	6.06	0	6.06	24	Pass
NVNT	ax40	5310	Sum	9	0	9	24	Pass
NVNT	ax40	5510	Ant1	5.61	0	5.61	24	Pass
NVNT	ax40	5510	Ant2	6.76	0	6.76	24	Pass
NVNT	ax40	5510	Sum	9.23	0	9.23	24	Pass
NVNT	ax40	5550	Ant1	4.95	0	4.95	24	Pass
NVNT	ax40	5550	Ant2	7.03	0	7.03	24	Pass
NVNT	ax40	5550	Sum	9.12	0	9.12	24	Pass
NVNT	ax40	5670	Ant1	4.53	0	4.53	24	Pass
NVNT	ax40	5670	Ant2	7.09	0	7.09	24	Pass
NVNT	ax40	5670	Sum	9.01	0	9.01	24	Pass
NVNT	ax40	5755	Ant1	4.38	0	4.38	30	Pass
NVNT	ax40	5755	Ant2	6.12	0	6.12	30	Pass
NVNT	ax40	5755	Sum	8.35	0	8.35	30	Pass
NVNT	ax40	5795	Ant1	5.02	0	5.02	30	Pass
NVNT	ax40	5795	Ant2	6.36	0	6.36	30	Pass
NVNT	ax40	5795	Sum	8.75	0	8.75	30	Pass
NVNT	ax80	5210	Ant1	6.39	0	6.39	24	Pass
NVNT	ax80	5290	Ant1	6.95	0	6.95	24	Pass
NVNT	ax80	5530	Ant1	6.59	0	6.59	24	Pass
NVNT	ax80	5610	Ant1	6.68	0	6.68	24	Pass
NVNT	ax80	5775	Ant1	6.74	0	6.74	30	Pass
NVNT	ax80	5210	Ant2	7.26	0	7.26	24	Pass
NVNT	ax80	5290	Ant2	8.44	0	8.44	24	Pass
NVNT	ax80	5530	Ant2	8.75	0	8.75	24	Pass
NVNT	ax80	5610	Ant2	8.6	0	8.6	24	Pass
NVNT	ax80	5775	Ant2	7.69	0	7.69	30	Pass
NVNT	ax80	5210	Ant1	5.11	0	5.11	24	Pass
NVNT	ax80	5210	Ant2	4.54	0	4.54	24	Pass
NVNT	ax80	5210	Sum	7.84	0	7.84	24	Pass
NVNT	ax80	5290	Ant1	5.01	0	5.01	24	Pass
NVNT	ax80	5290	Ant2	5.73	0	5.73	24	Pass
NVNT	ax80	5290	Sum	8.4	0	8.4	24	Pass
NVNT	ax80	5530	Ant1	5.22	0	5.22	24	Pass
NVNT	ax80	5530	Ant2	6.69	0	6.69	24	Pass
NVNT	ax80	5530	Sum	9.03	0	9.03	24	Pass
NVNT	ax80	5610	Ant1	5.09	0	5.09	24	Pass
NVNT	ax80	5610	Ant2	6.22	0	6.22	24	Pass
NVNT	ax80	5610	Sum	8.7	0	8.7	24	Pass



NVNT	ax80	5775	Ant1	4.53	0	4.53	30	Pass
NVNT	ax80	5775	Ant2	6.02	0	6.02	30	Pass
NVNT	ax80	5775	Sum	8.35	0	8.35	30	Pass



APPENDIX II - PHOTOGRAPHS OF EUT CONSTRUCTIONAL DETAILS

Note: Please see the attached TANK 3s_External Photos and TANK 3s_Internal Photos.

※※※※※END OF THE REPORT※※※※※