


Spurious Emissions at Antenna Terminal**FCC Part 22H****B5 , Normal**

Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-29.12	See Graphs	Pass
1.4MHz_Low_QPSK_6@0(30MHz~9.49GHz)	-29.10	See Graphs	Pass
1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-28.18	See Graphs	Pass
1.4MHz_Middle_QPSK_6@0(30MHz~9.49GHz)	-29.41	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)	-28.86	See Graphs	Pass
1.4MHz_High_QPSK_6@0(30MHz~9.49GHz)	-29.50	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-29.56	See Graphs	Pass
3MHz_Low_QPSK_15@0(30MHz~9.49GHz)	-28.78	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-28.19	See Graphs	Pass
3MHz_Middle_QPSK_15@0(30MHz~9.49GHz)	-28.84	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~9.49GHz)	-29.23	See Graphs	Pass
3MHz_High_QPSK_15@0(30MHz~9.49GHz)	-29.08	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-28.80	See Graphs	Pass
5MHz_Low_QPSK_25@0(30MHz~9.49GHz)	-28.86	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-28.17	See Graphs	Pass
5MHz_Middle_QPSK_25@0(30MHz~9.49GHz)	-28.85	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~9.49GHz)	-29.12	See Graphs	Pass
5MHz_High_QPSK_25@0(30MHz~9.49GHz)	-29.15	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-29.38	See Graphs	Pass
10MHz_Low_QPSK_50@0(30MHz~9.49GHz)	-29.47	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-29.38	See Graphs	Pass
10MHz_Middle_QPSK_50@0(30MHz~9.49GHz)	-29.20	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~9.49GHz)	-28.96	See Graphs	Pass
10MHz_High_QPSK_50@0(30MHz~9.49GHz)	-28.66	See Graphs	Pass


Note:1RB was the worst case.

B5 , Normal
1RB was the worst case


1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)

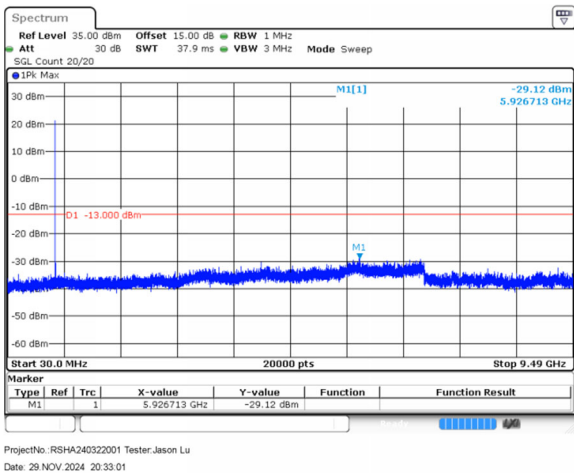


1.4MHz_Low_QPSK_6@0(30MHz~9.49GHz)

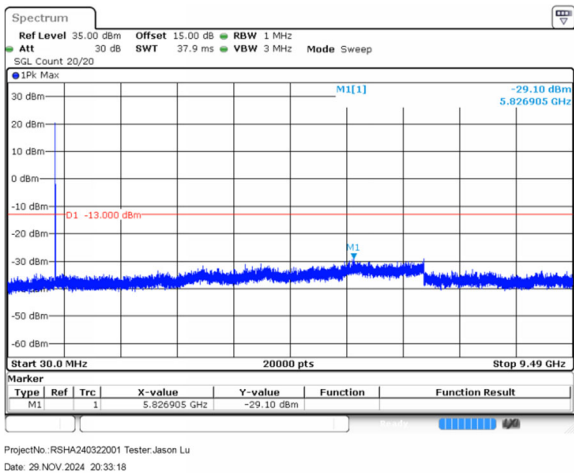


1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

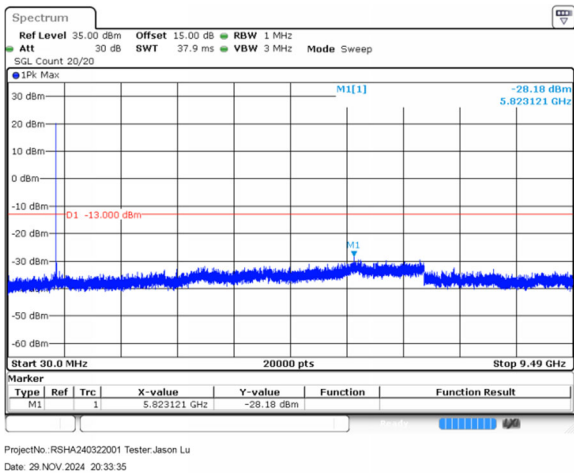


1.4MHz_Middle_QPSK_6@0(30MHz~9.49GHz)

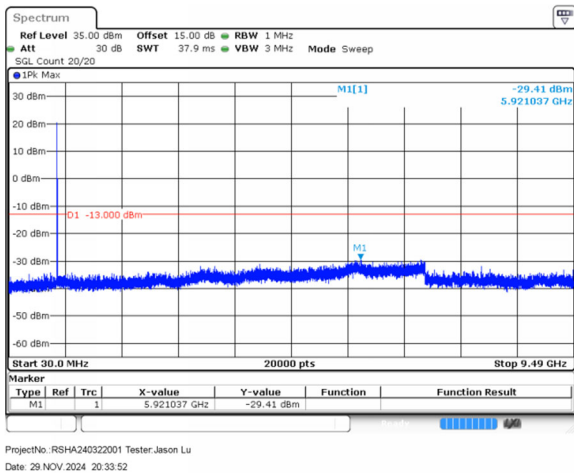


1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)

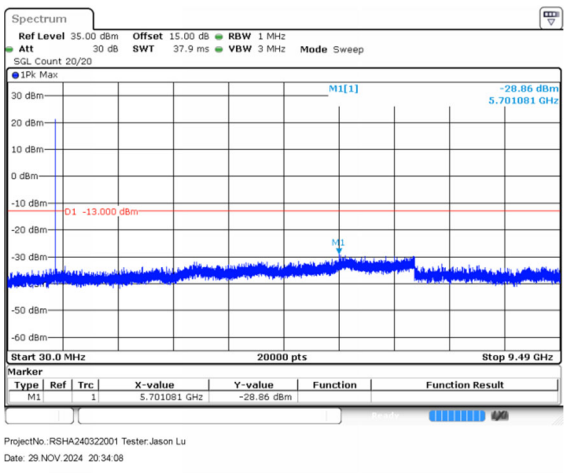

1.4MHz_High_QPSK_6@0(30MHz~9.49GHz)

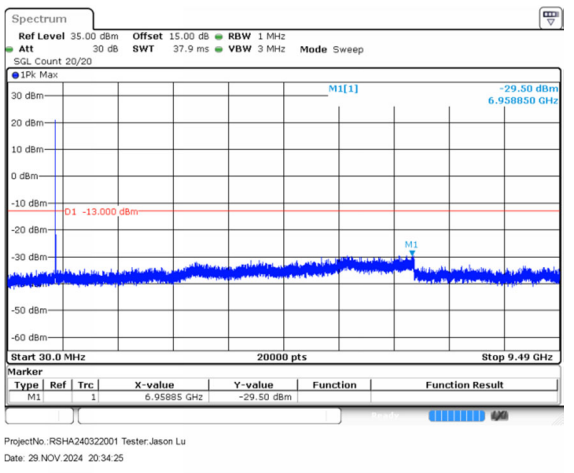


3MHz_Low_QPSK_1@0(30MHz~9.49GHz)

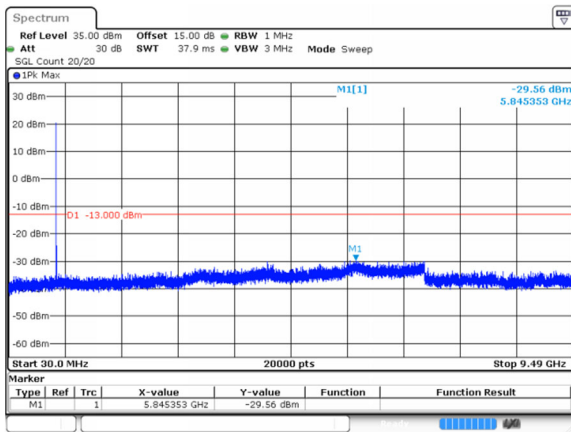


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 20:35:08

3MHz_Low_QPSK_15@0(30MHz~9.49GHz)

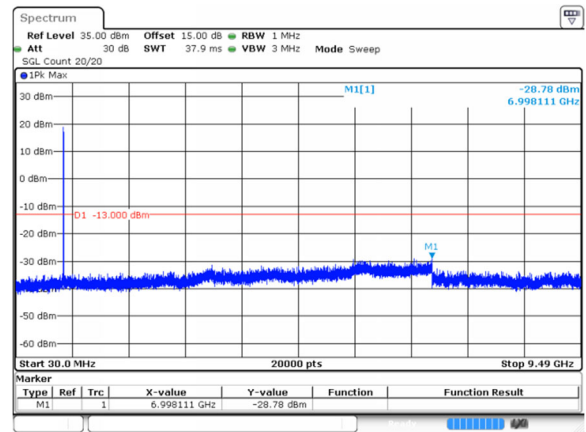


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 20:35:25

3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

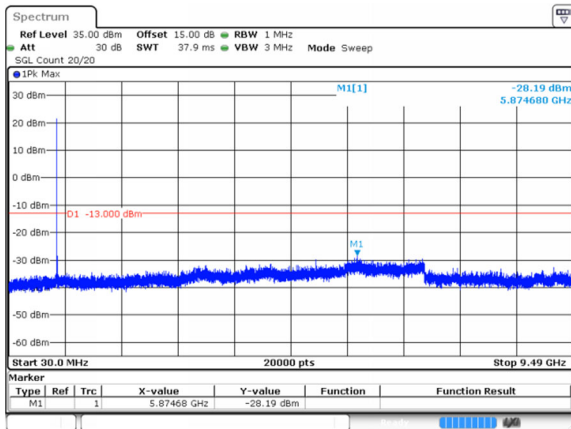


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 20:35:41

3MHz_Middle_QPSK_15@0(30MHz~9.49GHz)

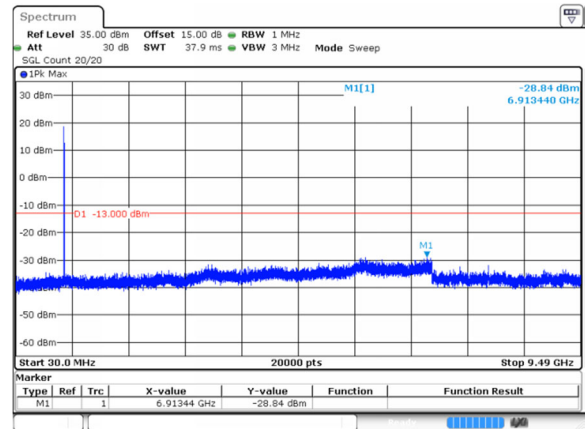


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 20:35:57

3MHz_High_QPSK_1@0(30MHz~9.49GHz)

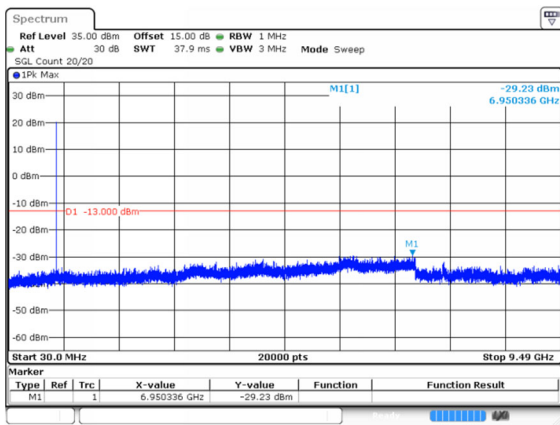


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 20:36:14

3MHz_High_QPSK_15@0(30MHz~9.49GHz)

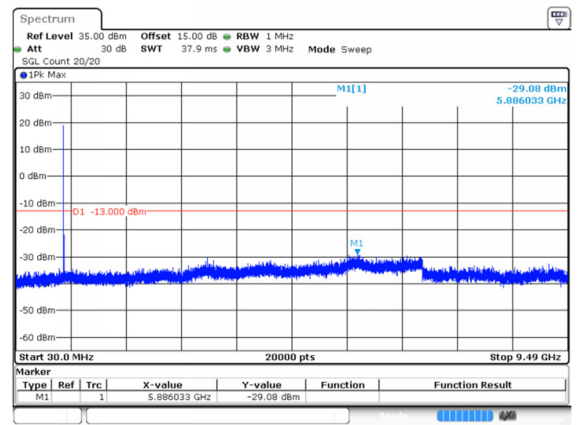


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 20:36:30

5MHz_Low_QPSK_1@0(30MHz~9.49GHz)

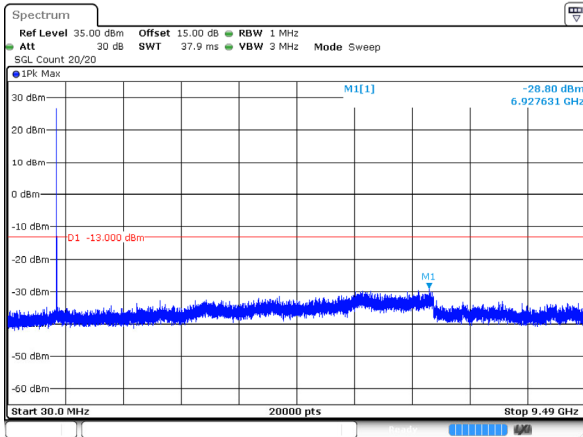


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 20 DEC 2024 09:51:45

5MHz_Low_QPSK_25@0(30MHz~9.49GHz)

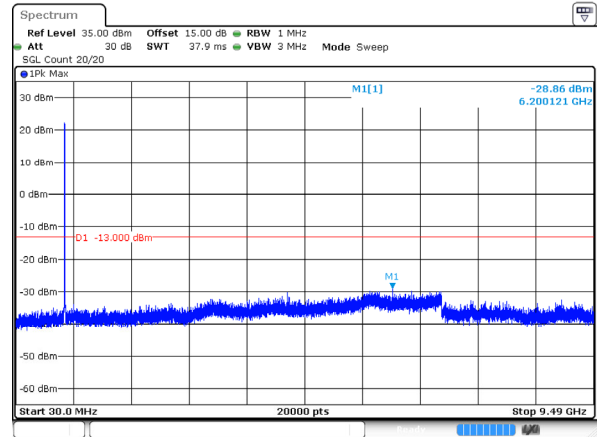


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 20 DEC 2024 09:51:56

5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

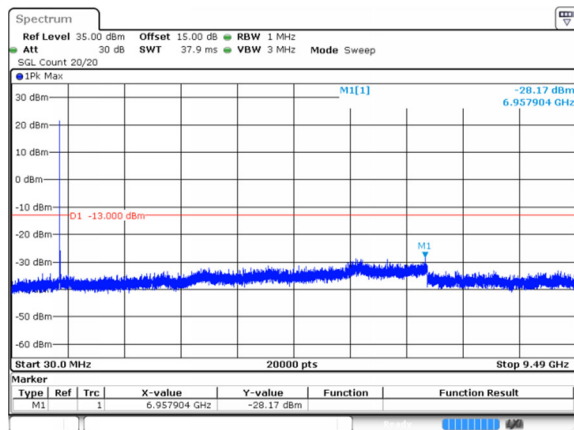


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 20:52:04

5MHz_Middle_QPSK_25@0(30MHz~9.49GHz)

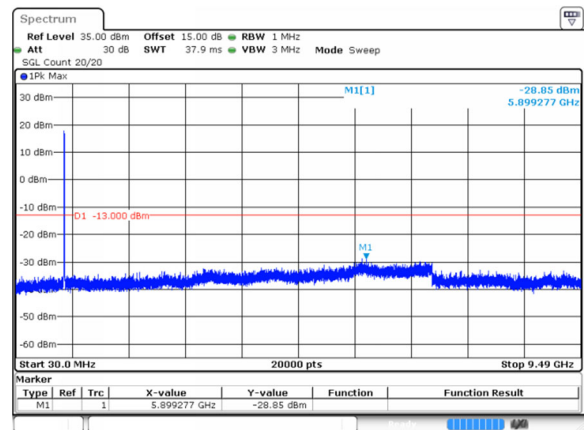


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 20:52:21

5MHz_High_QPSK_1@0(30MHz~9.49GHz)

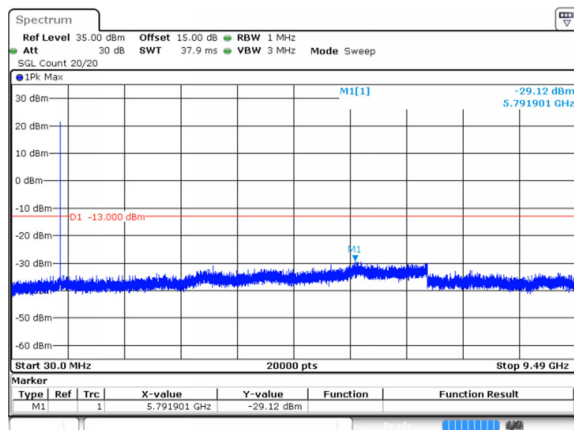


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 20:52:38

5MHz_High_QPSK_25@0(30MHz~9.49GHz)

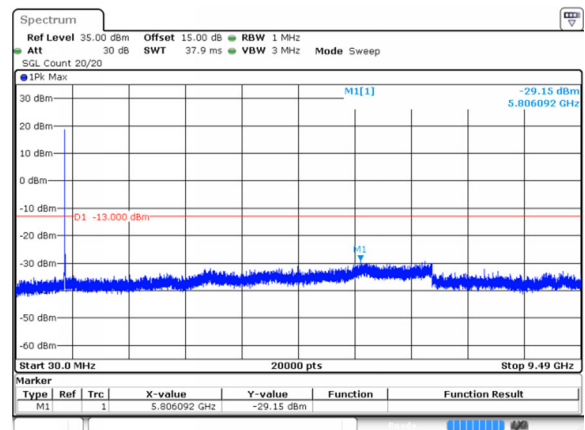


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 20:52:56

10MHz_Low_QPSK_1@0(30MHz~9.49GHz)

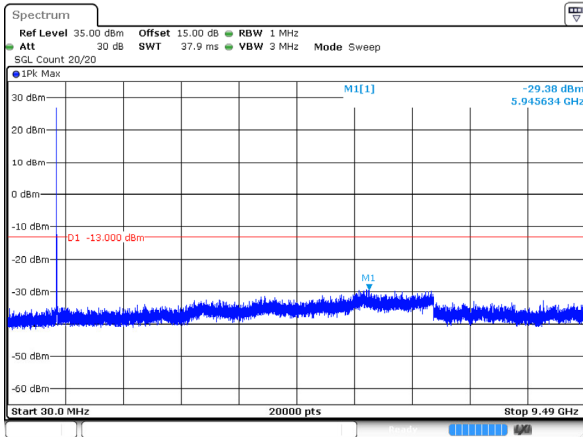


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 20 DEC 2024 09:52:49

10MHz_Low_QPSK_50@0(30MHz~9.49GHz)

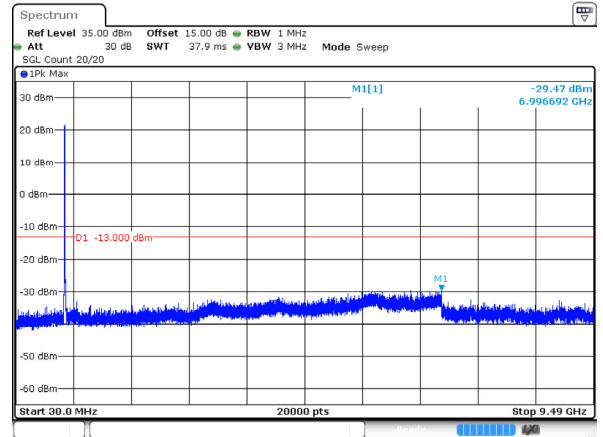


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 20 DEC 2024 09:53:00

10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)

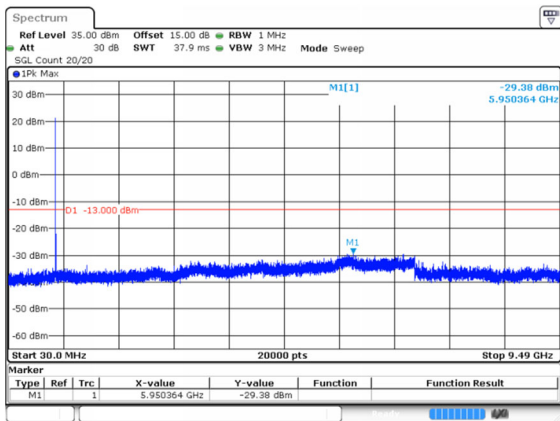


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:08:39

10MHz_Middle_QPSK_50@0(30MHz~9.49GHz)

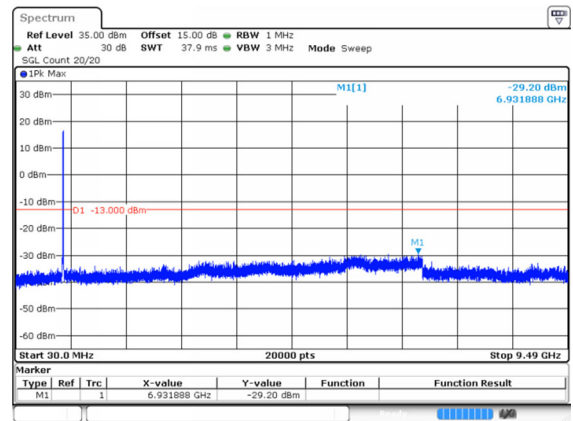


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:08:57

10MHz_High_QPSK_1@0(30MHz~9.49GHz)

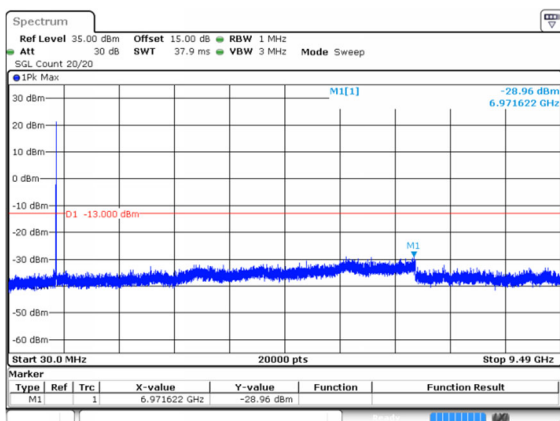

ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:09:15

10MHz_High_QPSK_50@0(30MHz~9.49GHz)

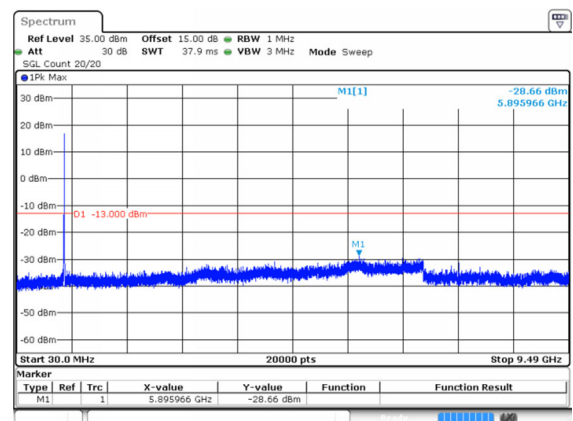


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:09:32


Spurious Emissions at Antenna Terminal**FCC Part 90****B14 , Normal**

Mode	Value (dBm)	Limit	Verdict
5MHz_Low_QPSK_1@0(30MHz~8.98GHz)	-29.16	See Graphs	Pass
5MHz_Low_QPSK_25@0(30MHz~8.98GHz)	-28.95	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~8.98GHz)	-29.35	See Graphs	Pass
5MHz_Middle_QPSK_25@0(30MHz~8.98GHz)	-29.12	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~8.98GHz)	-29.12	See Graphs	Pass
5MHz_High_QPSK_25@0(30MHz~8.98GHz)	-29.51	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~8.98GHz)	-29.54	See Graphs	Pass
10MHz_Low_QPSK_50@0(30MHz~8.98GHz)	-28.88	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~8.98GHz)	-29.30	See Graphs	Pass
10MHz_Middle_QPSK_50@0(30MHz~8.98GHz)	-29.88	See Graphs	Pass
10MHz_High_QPSK_1@0(30MHz~8.98GHz)	-28.19	See Graphs	Pass
10MHz_High_QPSK_50@0(30MHz~8.98GHz)	-28.82	See Graphs	Pass
5MHz_Low_QPSK_1@0(1559MHz~1610MHz)	-42.50	See Graphs	Pass
5MHz_Low_QPSK_25@0(1559MHz~1610MHz)	-43.28	See Graphs	Pass
5MHz_Middle_QPSK_1@0(1559MHz~1610MHz)	-41.60	See Graphs	Pass
5MHz_Middle_QPSK_25@0(1559MHz~1610MHz)	-43.90	See Graphs	Pass
5MHz_High_QPSK_1@0(1559MHz~1610MHz)	-41.64	See Graphs	Pass
5MHz_High_QPSK_25@0(1559MHz~1610MHz)	-44.16	See Graphs	Pass
10MHz_Low_QPSK_1@0(1559MHz~1610MHz)	-42.07	See Graphs	Pass
10MHz_Low_QPSK_50@0(1559MHz~1610MHz)	-44.09	See Graphs	Pass
10MHz_Middle_QPSK_1@0(1559MHz~1610MHz)	-42.01	See Graphs	Pass
10MHz_Middle_QPSK_50@0(1559MHz~1610MHz)	-43.84	See Graphs	Pass
10MHz_High_QPSK_1@0(1559MHz~1610MHz)	-41.97	See Graphs	Pass
10MHz_High_QPSK_50@0(1559MHz~1610MHz)	-43.62	See Graphs	Pass


Note:1RB was the worst case.

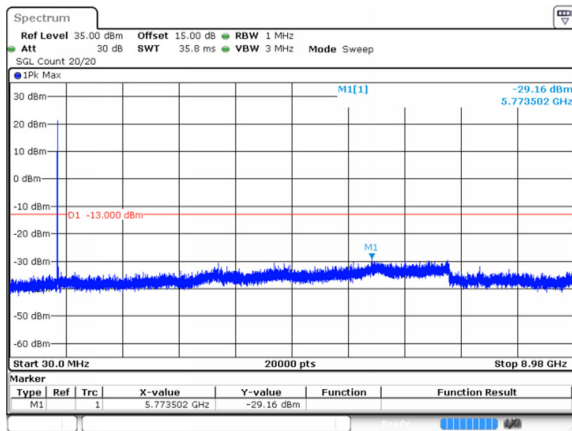B14, Normal**1RB was the worst case****5MHz_Low_QPSK_1@0(30MHz~8.98GHz)**


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:41:14

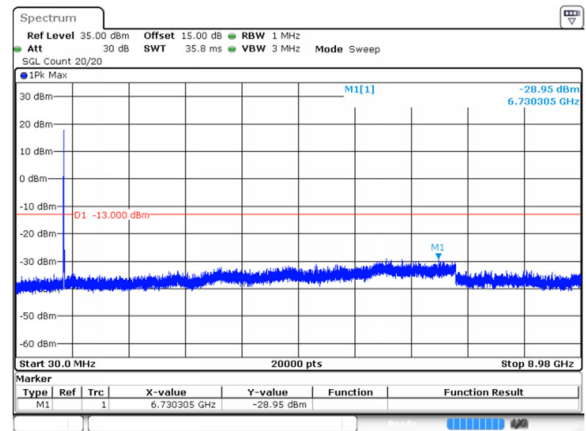5MHz_Low_QPSK_25@0(30MHz~8.98GHz)


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:41:33

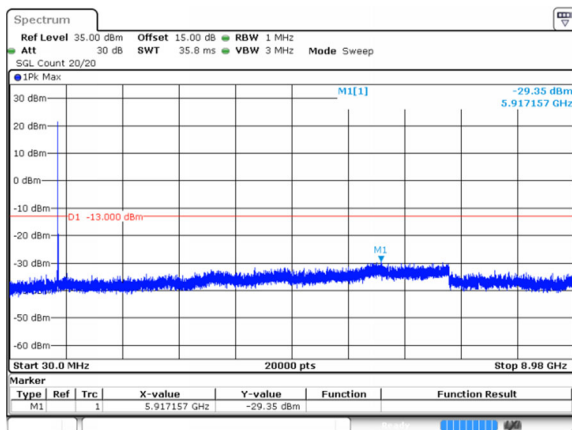5MHz_Middle_QPSK_1@0(30MHz~8.98GHz)


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:41:52

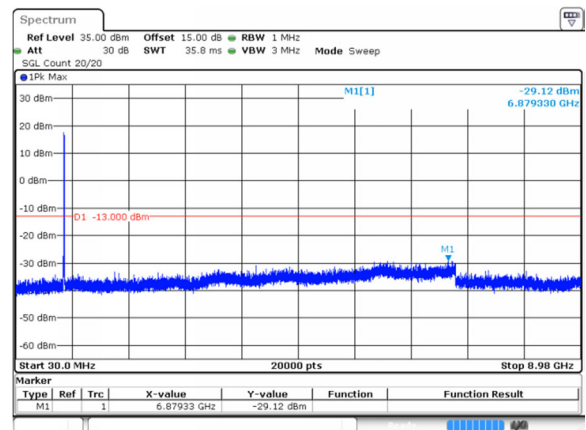5MHz_Middle_QPSK_25@0(30MHz~8.98GHz)

ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:42:10

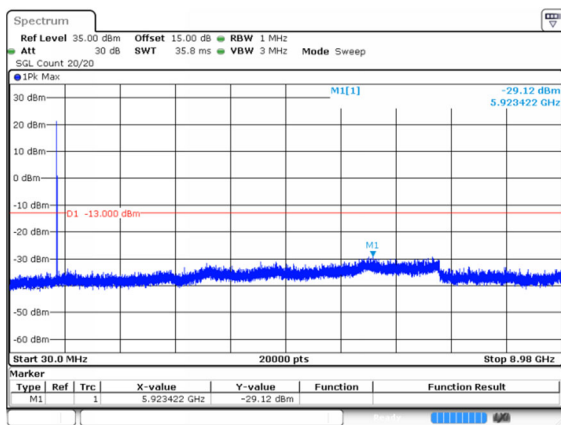
5MHz_High_QPSK_1@0(30MHz~8.98GHz)

ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:42:29

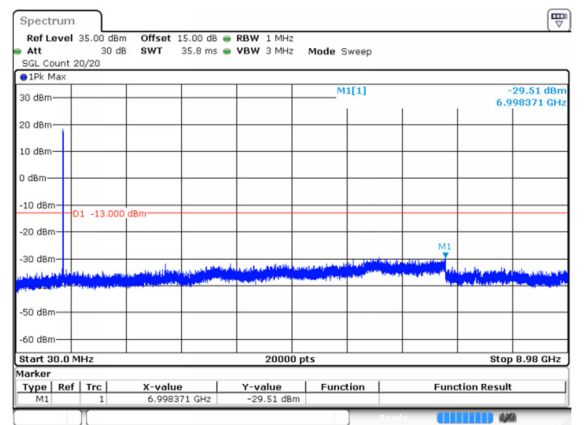5MHz_High_QPSK_25@0(30MHz~8.98GHz)


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:42:48

10MHz_Low_QPSK_1@0(30MHz~8.98GHz)

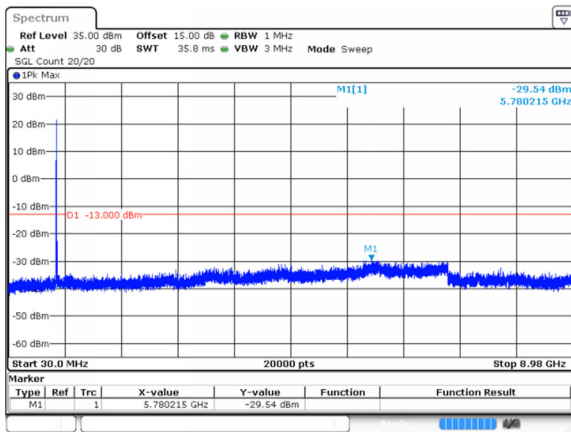


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:44:25

10MHz_Low_QPSK_50@0(30MHz~8.98GHz)

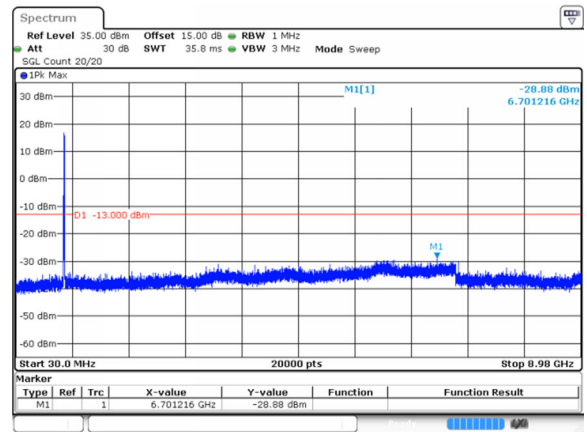


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:44:44

10MHz_Middle_QPSK_1@0(30MHz~8.98GHz)

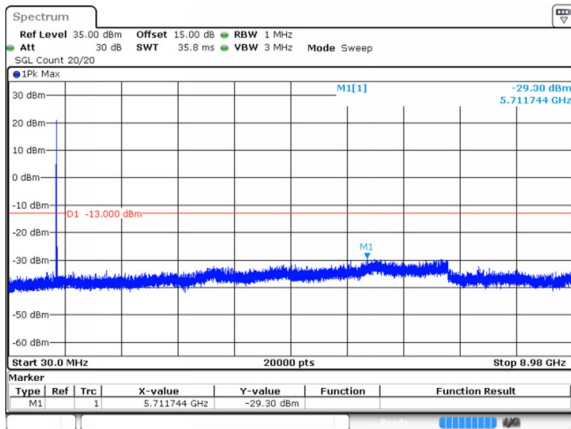


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:45:03

10MHz_Middle_QPSK_50@0(30MHz~8.98GHz)

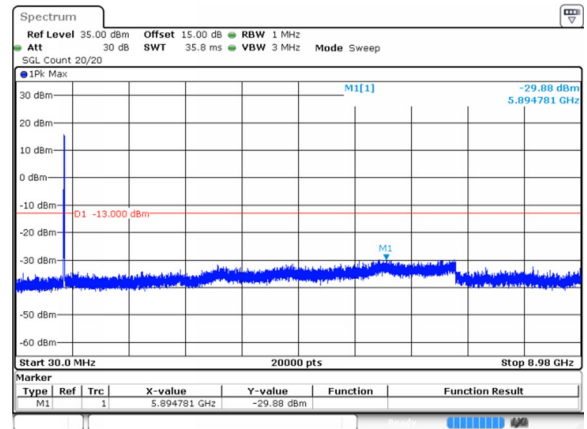


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:45:22

10MHz_High_QPSK_1@0(30MHz~8.98GHz)

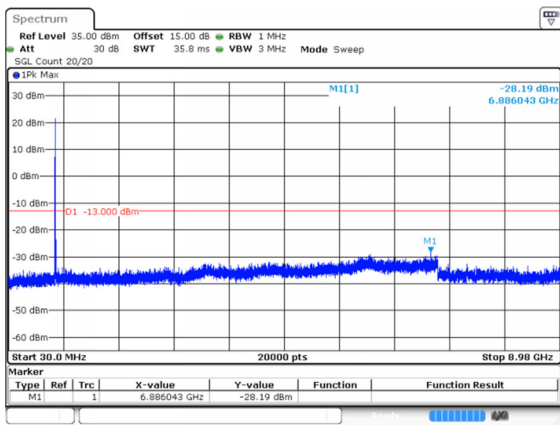


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:45:41

10MHz_High_QPSK_50@0(30MHz~8.98GHz)

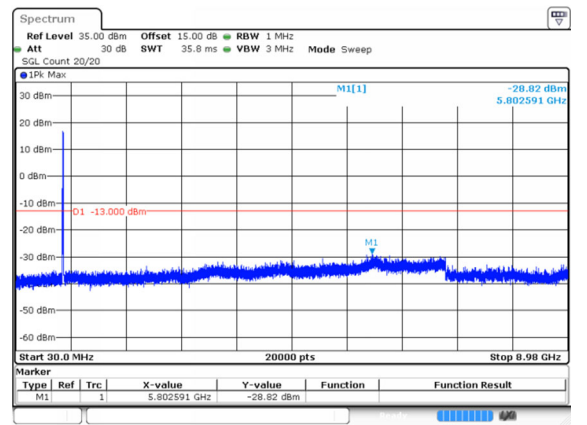


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 29 NOV 2024 21:46:00

5MHz_Low_QPSK_1@0(1559MHz~1610MHz)

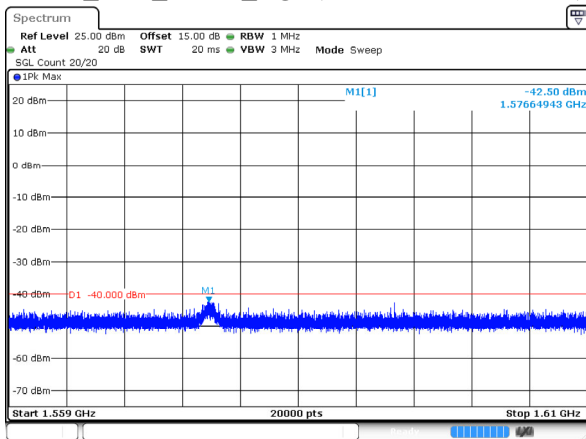


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:53:23

5MHz_Low_QPSK_25@0(1559MHz~1610MHz)

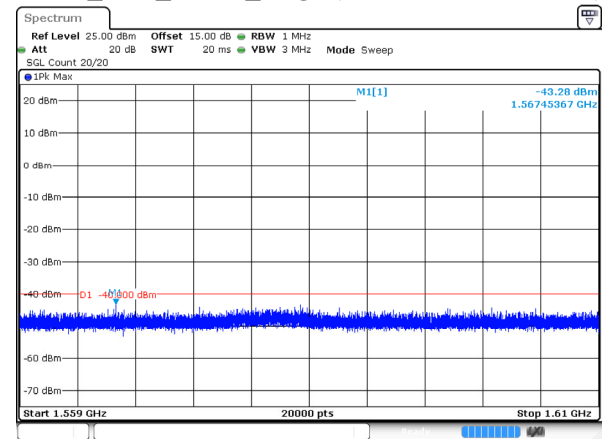


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:53:32

5MHz_Middle_QPSK_1@0(1559MHz~1610MHz)

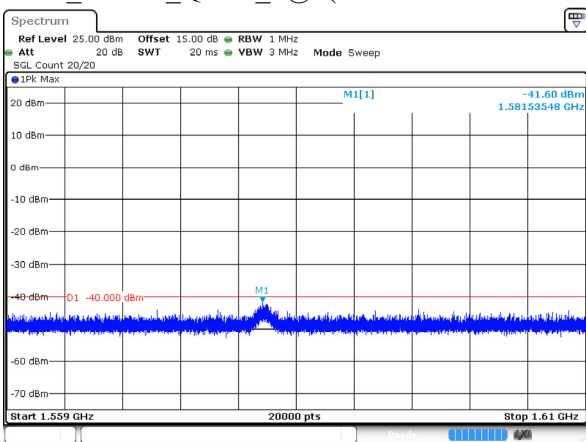


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:53:41

5MHz_Middle_QPSK_25@0(1559MHz~1610MHz)

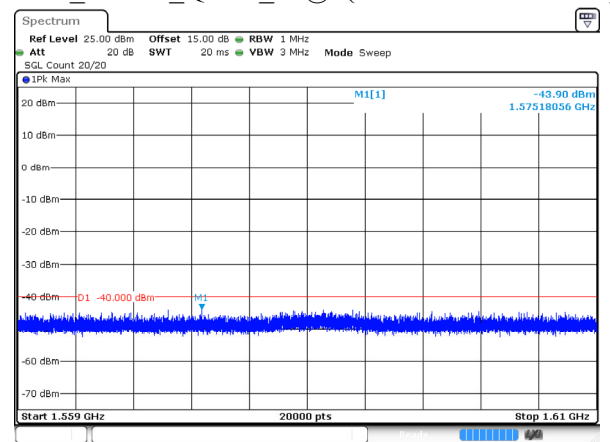


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:53:50

5MHz_High_QPSK_1@0(1559MHz~1610MHz)

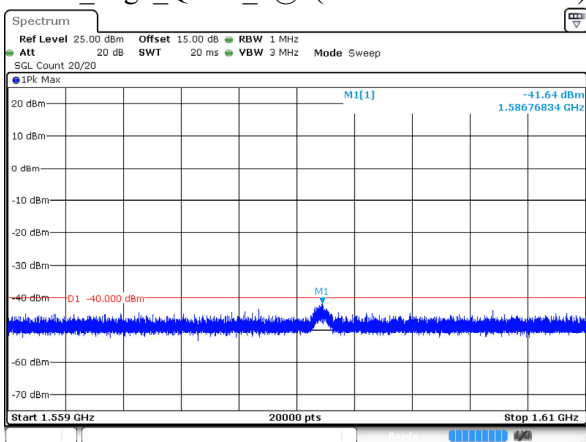


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:53:59

5MHz_High_QPSK_25@0(1559MHz~1610MHz)

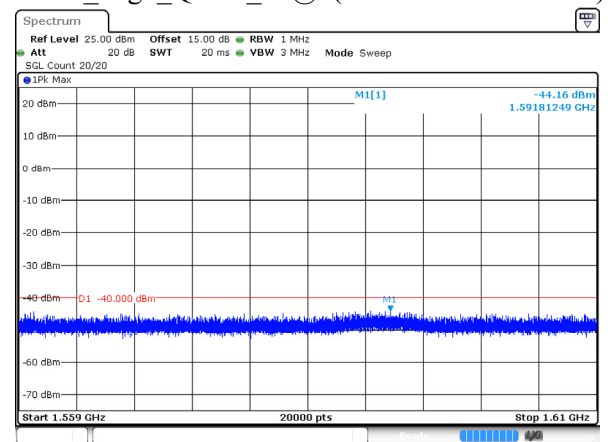


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:54:09

10MHz_Low_QPSK_1@0(1559MHz~1610MHz)

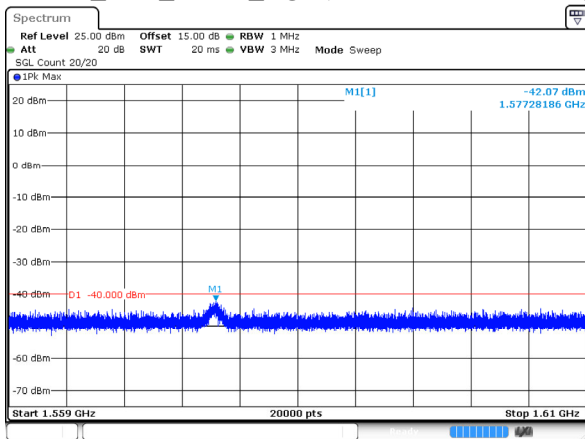


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:54:48

10MHz_Low_QPSK_50@0(1559MHz~1610MHz)

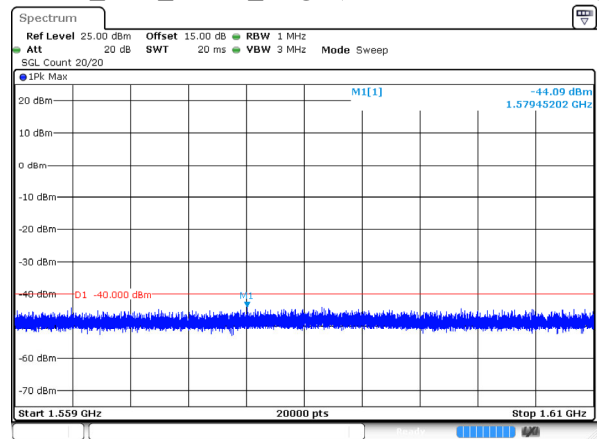


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:54:57

10MHz_Middle_QPSK_1@0(1559MHz~1610MHz)

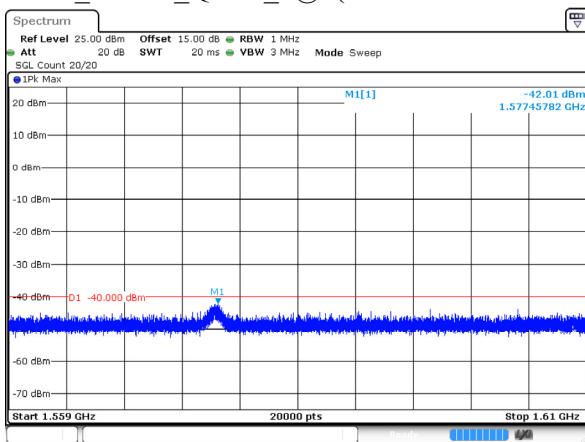


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:55:06

10MHz_Middle_QPSK_50@0(1559MHz~1610MHz)

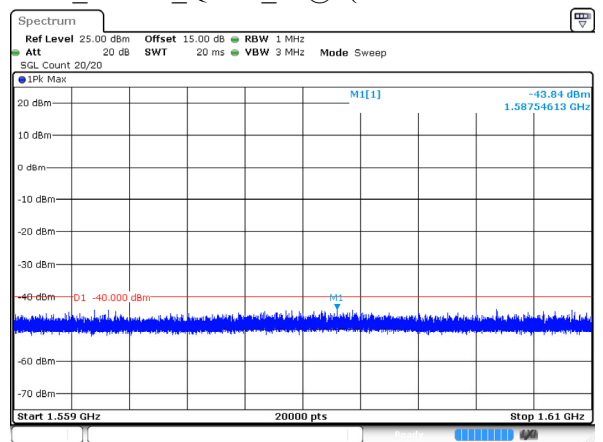


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:55:15

10MHz_High_QPSK_1@0(1559MHz~1610MHz)

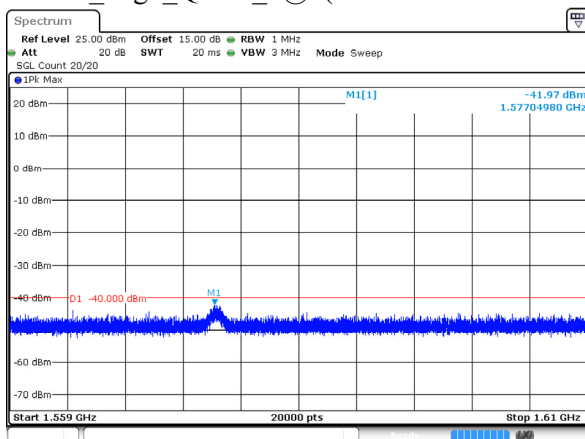

ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:55:24

10MHz_High_QPSK_50@0(1559MHz~1610MHz)

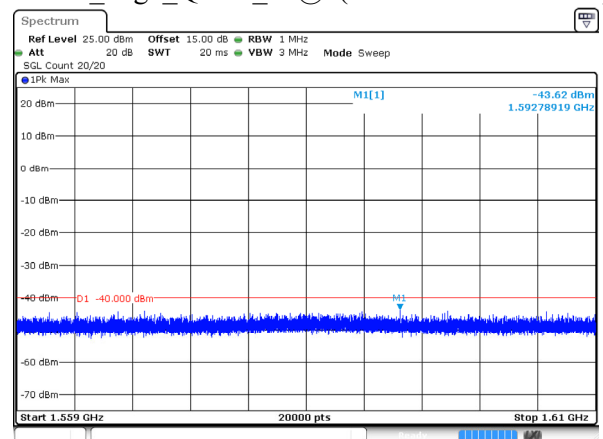


ProjectNo.: RSHA240322001 Tester: Jason Lu
Date: 20 DEC 2024 11:55:34


Spurious Emissions at Antenna Terminal**FCC Part 22H****B26_2 , Normal**

Mode	Value (dBm)	Limit	Verdict
2_1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-29.60	See Graphs	Pass
2_1.4MHz_Low_QPSK_6@0(30MHz~9.49GHz)	-29.19	See Graphs	Pass
2_1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-29.20	See Graphs	Pass
2_1.4MHz_Middle_QPSK_6@0(30MHz~9.49GHz)	-29.79	See Graphs	Pass
2_1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)	-29.16	See Graphs	Pass
2_1.4MHz_High_QPSK_6@0(30MHz~9.49GHz)	-29.32	See Graphs	Pass
2_3MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-28.92	See Graphs	Pass
2_3MHz_Low_QPSK_15@0(30MHz~9.49GHz)	-29.66	See Graphs	Pass
2_3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-29.97	See Graphs	Pass
2_3MHz_Middle_QPSK_15@0(30MHz~9.49GHz)	-30.12	See Graphs	Pass
2_3MHz_High_QPSK_1@0(30MHz~9.49GHz)	-29.58	See Graphs	Pass
2_3MHz_High_QPSK_15@0(30MHz~9.49GHz)	-29.66	See Graphs	Pass
2_5MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-29.25	See Graphs	Pass
2_5MHz_Low_QPSK_25@0(30MHz~9.49GHz)	-29.23	See Graphs	Pass
2_5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-29.98	See Graphs	Pass
2_5MHz_Middle_QPSK_25@0(30MHz~9.49GHz)	-29.84	See Graphs	Pass
2_5MHz_High_QPSK_1@0(30MHz~9.49GHz)	-29.03	See Graphs	Pass
2_5MHz_High_QPSK_25@0(30MHz~9.49GHz)	-29.28	See Graphs	Pass
2_10MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-29.63	See Graphs	Pass
2_10MHz_Low_QPSK_50@0(30MHz~9.49GHz)	-29.45	See Graphs	Pass
2_10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-28.44	See Graphs	Pass
2_10MHz_Middle_QPSK_50@0(30MHz~9.49GHz)	-30.05	See Graphs	Pass
2_10MHz_High_QPSK_1@0(30MHz~9.49GHz)	-29.79	See Graphs	Pass
2_10MHz_High_QPSK_50@0(30MHz~9.49GHz)	-29.78	See Graphs	Pass
2_15MHz_Low_QPSK_1@0(30MHz~9.49GHz)	-29.85	See Graphs	Pass
2_15MHz_Low_QPSK_75@0(30MHz~9.49GHz)	-29.32	See Graphs	Pass
2_15MHz_Middle_QPSK_1@0(30MHz~9.49GHz)	-29.12	See Graphs	Pass
2_15MHz_Middle_QPSK_75@0(30MHz~9.49GHz)	-28.97	See Graphs	Pass
2_15MHz_High_QPSK_1@0(30MHz~9.49GHz)	-29.50	See Graphs	Pass
2_15MHz_High_QPSK_75@0(30MHz~9.49GHz)	-30.02	See Graphs	Pass


Note:1RB was the worst case.

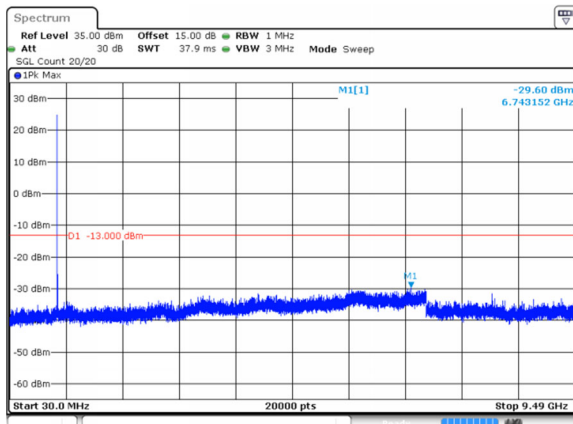B26_2 , Normal**1RB was the worst case****2_1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)**


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 2 DEC 2024 11:26:40

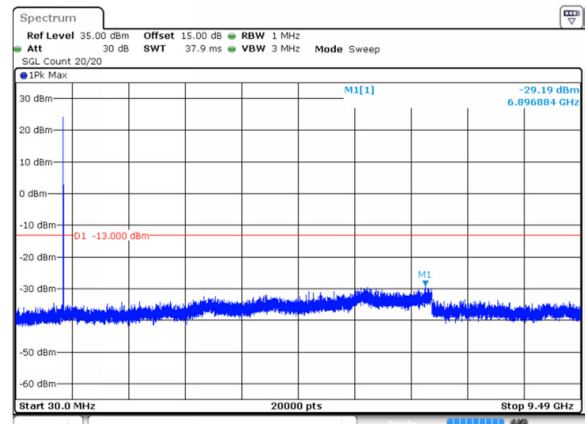2_1.4MHz_Low_QPSK_6@0(30MHz~9.49GHz)


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 2 DEC 2024 11:26:58

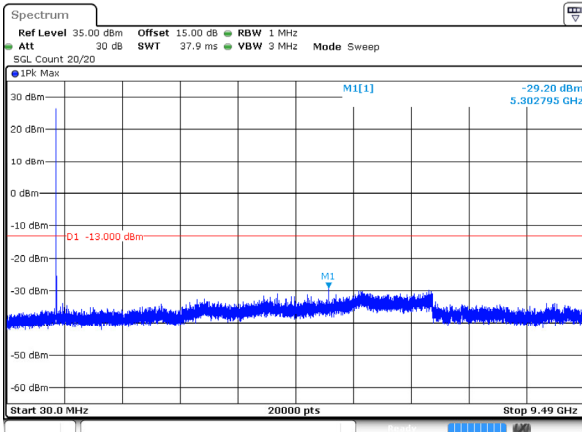2_1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz)


ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 27 DEC 2024 14:29:42

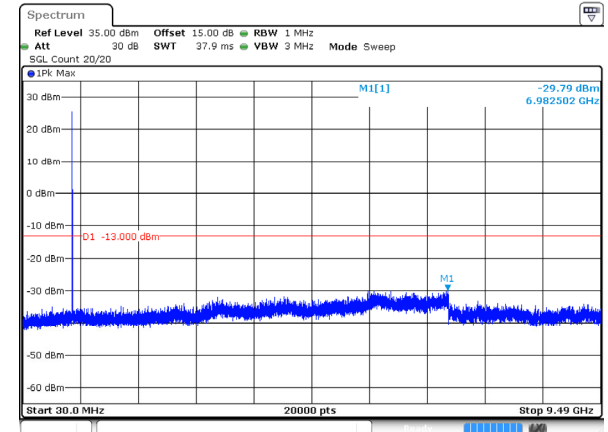2_1.4MHz_Middle_QPSK_6@0(30MHz~9.49GHz)

ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 27 DEC 2024 14:30:16

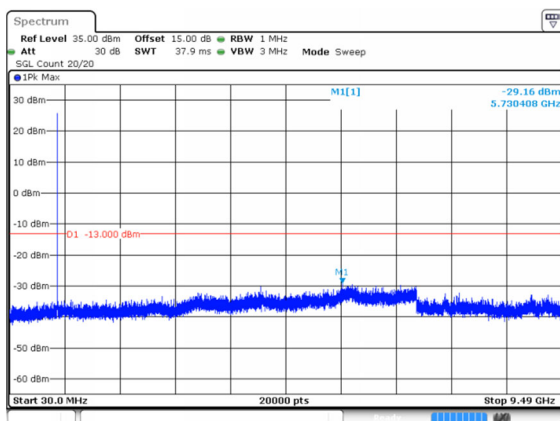2_1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)

ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 2 DEC 2024 11:27:43

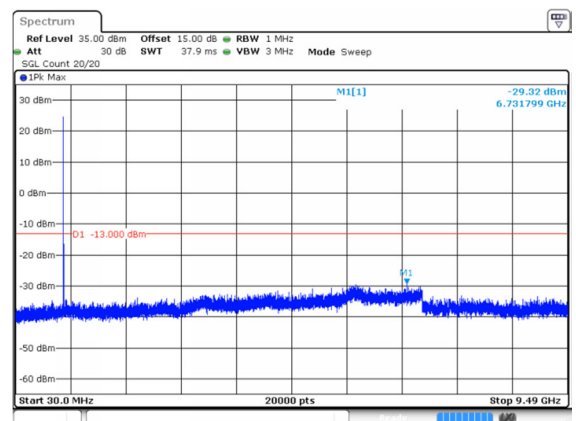2_1.4MHz_High_QPSK_6@0(30MHz~9.49GHz)

ProjectNo.:RSHA240322001 Tester:Jason Lu
Date: 2 DEC 2024 11:27:58