

NVNT	ax40	6885	Ant1	-10.31	6.62	-3.58	-1	Pass
NVNT	ax40	6925	Ant1	-10.34	6.62	-3.72	-1	Pass
NVNT	ax40	6965	Ant1	-11.91	6.62	-5.17	-1	Pass
NVNT	ax40	7085	Ant1	-9.2	6.62	-2.48	-1	Pass
NVNT	ax40	5965	Ant2	-8.22	6.62	-1.6	-1	Pass
NVNT	ax40	6165	Ant2	-7.96	6.62	-1.34	-1	Pass
NVNT	ax40	6405	Ant2	-9.5	6.62	-2.79	-1	Pass
NVNT	ax40	6445	Ant2	-9.17	6.62	-2.55	-1	Pass
NVNT	ax40	6485	Ant2	-9.26	6.62	-2.64	-1	Pass
NVNT	ax40	6525	Ant2	-9.39	6.62	-2.63	-1	Pass
NVNT	ax40	6565	Ant2	-8.43	6.62	-1.7	-1	Pass
NVNT	ax40	6685	Ant2	-7.67	6.62	-1.05	-1	Pass
NVNT	ax40	6845	Ant2	-9.69	6.62	-2.98	-1	Pass
NVNT	ax40	6885	Ant2	-9.65	6.62	-3.03	-1	Pass
NVNT	ax40	6925	Ant2	-10.08	6.62	-3.33	-1	Pass
NVNT	ax40	6965	Ant2	-10.13	6.62	-3.51	-1	Pass
NVNT	ax40	7085	Ant2	-7.74	6.62	-1.12	-1	Pass
NVNT	ax40	5965	Ant3	-10.9	6.62	-4.28	-1	Pass
NVNT	ax40	6165	Ant3	-7.76	6.62	-1.14	-1	Pass
NVNT	ax40	6405	Ant3	-8.63	6.62	-2.01	-1	Pass
NVNT	ax40	6445	Ant3	-9.09	6.62	-2.47	-1	Pass
NVNT	ax40	6485	Ant3	-8.21	6.62	-1.59	-1	Pass
NVNT	ax40	6525	Ant3	-8.36	6.62	-1.74	-1	Pass
NVNT	ax40	6565	Ant3	-7.97	6.62	-1.25	-1	Pass
NVNT	ax40	6685	Ant3	-7.89	6.62	-1.27	-1	Pass
NVNT	ax40	6845	Ant3	-9.15	6.62	-2.53	-1	Pass
NVNT	ax40	6885	Ant3	-10.99	6.62	-4.37	-1	Pass
NVNT	ax40	6925	Ant3	-10.89	6.62	-4.27	-1	Pass
NVNT	ax40	6965	Ant3	-9.76	6.62	-3.02	-1	Pass
NVNT	ax40	7085	Ant3	-9.28	6.62	-2.66	-1	Pass
NVNT	ax40	5965	Ant4	-8.76	6.62	-2.14	-1	Pass
NVNT	ax40	6165	Ant4	-9.3	6.62	-2.58	-1	Pass
NVNT	ax40	6405	Ant4	-8.47	6.62	-1.85	-1	Pass
NVNT	ax40	6445	Ant4	-8.81	6.62	-2.19	-1	Pass
NVNT	ax40	6485	Ant4	-8.03	6.62	-1.41	-1	Pass
NVNT	ax40	6525	Ant4	-8.27	6.62	-1.65	-1	Pass
NVNT	ax40	6565	Ant4	-9.86	6.62	-3.12	-1	Pass
NVNT	ax40	6685	Ant4	-8.56	6.62	-1.84	-1	Pass
NVNT	ax40	6845	Ant4	-9.63	6.62	-3.01	-1	Pass
NVNT	ax40	6885	Ant4	-10.67	6.62	-4.05	-1	Pass
NVNT	ax40	6925	Ant4	-10.78	6.62	-4.06	-1	Pass
NVNT	ax40	6965	Ant4	-8.96	6.62	-2.34	-1	Pass
NVNT	ax40	7085	Ant4	-8.85	6.62	-2.11	-1	Pass
NVNT	ax40	5965	Ant1	-24.8	6.62	-18.08	-1	Pass

NVNT	ax40	5965	Ant2	-26.38	6.62	-19.66	-1	Pass
NVNT	ax40	5965	Ant3	-31.28	6.62	-24.56	-1	Pass
NVNT	ax40	5965	Ant4	-29.19	6.62	-22.47	-1	Pass
NVNT	ax40	5965	Sum	-21.21	12.64	-8.57	-1	Pass
NVNT	ax40	6165	Ant1	-25.8	6.62	-19.18	-1	Pass
NVNT	ax40	6165	Ant2	-26.54	6.62	-19.92	-1	Pass
NVNT	ax40	6165	Ant3	-26.92	6.62	-20.3	-1	Pass
NVNT	ax40	6165	Ant4	-24.95	6.62	-18.33	-1	Pass
NVNT	ax40	6165	Sum	-19.97	12.64	-7.33	-1	Pass
NVNT	ax40	6405	Ant1	-27.79	6.62	-21.17	-1	Pass
NVNT	ax40	6405	Ant2	-28.68	6.62	-22.06	-1	Pass
NVNT	ax40	6405	Ant3	-29.48	6.62	-22.86	-1	Pass
NVNT	ax40	6405	Ant4	-27.94	6.62	-21.32	-1	Pass
NVNT	ax40	6405	Sum	-22.40	12.64	-9.76	-1	Pass
NVNT	ax40	6445	Ant1	-27.2	6.62	-20.48	-1	Pass
NVNT	ax40	6445	Ant2	-27.88	6.62	-21.16	-1	Pass
NVNT	ax40	6445	Ant3	-29.47	6.62	-22.75	-1	Pass
NVNT	ax40	6445	Ant4	-28.09	6.62	-21.37	-1	Pass
NVNT	ax40	6445	Sum	-22.06	12.64	-9.42	-1	Pass
NVNT	ax40	6485	Ant1	-27.52	6.62	-20.9	-1	Pass
NVNT	ax40	6485	Ant2	-28.99	6.62	-22.37	-1	Pass
NVNT	ax40	6485	Ant3	-30.48	6.62	-23.86	-1	Pass
NVNT	ax40	6485	Ant4	-29	6.62	-22.38	-1	Pass
NVNT	ax40	6485	Sum	-22.85	12.64	-10.21	-1	Pass
NVNT	ax40	6525	Ant1	-27.64	6.62	-20.88	-1	Pass
NVNT	ax40	6525	Ant2	-29.11	6.62	-22.35	-1	Pass
NVNT	ax40	6525	Ant3	-30.13	6.62	-23.37	-1	Pass
NVNT	ax40	6525	Ant4	-29.33	6.62	-22.57	-1	Pass
NVNT	ax40	6525	Sum	-22.94	12.64	-10.30	-1	Pass
NVNT	ax40	6565	Ant1	-28.1	6.62	-21.34	-1	Pass
NVNT	ax40	6565	Ant2	-27.57	6.62	-20.81	-1	Pass
NVNT	ax40	6565	Ant3	-30.62	6.62	-23.86	-1	Pass
NVNT	ax40	6565	Ant4	-29.93	6.62	-23.17	-1	Pass
NVNT	ax40	6565	Sum	-22.86	12.64	-10.22	-1	Pass
NVNT	ax40	6685	Ant1	-28.74	6.62	-22.12	-1	Pass
NVNT	ax40	6685	Ant2	-26.1	6.62	-19.48	-1	Pass
NVNT	ax40	6685	Ant3	-29.47	6.62	-22.85	-1	Pass
NVNT	ax40	6685	Ant4	-28.75	6.62	-22.13	-1	Pass
NVNT	ax40	6685	Sum	-22.04	12.64	-9.40	-1	Pass
NVNT	ax40	6845	Ant1	-24.64	6.62	-18.02	-1	Pass
NVNT	ax40	6845	Ant2	-24.26	6.62	-17.64	-1	Pass
NVNT	ax40	6845	Ant3	-26.37	6.62	-19.75	-1	Pass
NVNT	ax40	6845	Ant4	-25.4	6.62	-18.78	-1	Pass
NVNT	ax40	6845	Sum	-19.07	12.64	-6.43	-1	Pass

NVNT	ax40	6885	Ant1	-27.54	6.62	-20.79	-1	Pass
NVNT	ax40	6885	Ant2	-26.59	6.62	-19.84	-1	Pass
NVNT	ax40	6885	Ant3	-29.81	6.62	-23.06	-1	Pass
NVNT	ax40	6885	Ant4	-26.89	6.62	-20.14	-1	Pass
NVNT	ax40	6885	Sum	-21.52	12.64	-8.88	-1	Pass
NVNT	ax40	6925	Ant1	-27.92	6.62	-21.18	-1	Pass
NVNT	ax40	6925	Ant2	-28.11	6.62	-21.37	-1	Pass
NVNT	ax40	6925	Ant3	-29.06	6.62	-22.32	-1	Pass
NVNT	ax40	6925	Ant4	-27.51	6.62	-20.77	-1	Pass
NVNT	ax40	6925	Sum	-22.09	12.64	-9.45	-1	Pass
NVNT	ax40	6965	Ant1	-27.64	6.62	-21.02	-1	Pass
NVNT	ax40	6965	Ant2	-28.89	6.62	-22.27	-1	Pass
NVNT	ax40	6965	Ant3	-28.65	6.62	-22.03	-1	Pass
NVNT	ax40	6965	Ant4	-25.96	6.62	-19.34	-1	Pass
NVNT	ax40	6965	Sum	-21.60	12.64	-8.96	-1	Pass
NVNT	ax40	7085	Ant1	-27.53	6.62	-20.81	-1	Pass
NVNT	ax40	7085	Ant2	-28.75	6.62	-22.03	-1	Pass
NVNT	ax40	7085	Ant3	-29.01	6.62	-22.29	-1	Pass
NVNT	ax40	7085	Ant4	-27.02	6.62	-20.3	-1	Pass
NVNT	ax40	7085	Sum	-21.98	12.64	-9.34	-1	Pass
NVNT	ax80	5985	Ant1	-11.75	6.62	-5.13	-1	Pass
NVNT	ax80	6145	Ant1	-8.21	6.62	-1.59	-1	Pass
NVNT	ax80	6385	Ant1	-7.74	6.62	-1.12	-1	Pass
NVNT	ax80	6465	Ant1	-8.32	6.62	-1.56	-1	Pass
NVNT	ax80	6545	Ant1	-8.81	6.62	-2.09	-1	Pass
NVNT	ax80	6625	Ant1	-8.71	6.62	-1.96	-1	Pass
NVNT	ax80	6705	Ant1	-8.57	6.62	-1.85	-1	Pass
NVNT	ax80	6785	Ant1	-10.9	6.62	-4.28	-1	Pass
NVNT	ax80	6865	Ant1	-11.09	6.62	-4.36	-1	Pass
NVNT	ax80	6945	Ant1	-11.17	6.62	-4.43	-1	Pass
NVNT	ax80	7025	Ant1	-11.25	6.62	-4.63	-1	Pass
NVNT	ax80	5985	Ant2	-8.77	6.62	-2.15	-1	Pass
NVNT	ax80	6145	Ant2	-8.65	6.62	-2.03	-1	Pass
NVNT	ax80	6385	Ant2	-8.3	6.62	-1.68	-1	Pass
NVNT	ax80	6465	Ant2	-8.06	6.62	-1.32	-1	Pass
NVNT	ax80	6545	Ant2	-8.43	6.62	-1.68	-1	Pass
NVNT	ax80	6625	Ant2	-8.25	6.62	-1.63	-1	Pass
NVNT	ax80	6705	Ant2	-8.31	6.62	-1.69	-1	Pass
NVNT	ax80	6785	Ant2	-10.22	6.62	-3.6	-1	Pass
NVNT	ax80	6865	Ant2	-11.72	6.62	-5.1	-1	Pass
NVNT	ax80	6945	Ant2	-10.99	6.62	-4.37	-1	Pass
NVNT	ax80	7025	Ant2	-10.3	6.62	-3.57	-1	Pass
NVNT	ax80	5985	Ant3	-11.16	6.62	-4.54	-1	Pass
NVNT	ax80	6145	Ant3	-8.58	6.62	-1.86	-1	Pass

NVNT	ax80	6385	Ant3	-8.45	6.62	-1.83	-1	Pass
NVNT	ax80	6465	Ant3	-9.98	6.62	-3.36	-1	Pass
NVNT	ax80	6545	Ant3	-8.48	6.62	-1.73	-1	Pass
NVNT	ax80	6625	Ant3	-8.78	6.62	-2.03	-1	Pass
NVNT	ax80	6705	Ant3	-8.93	6.62	-2.21	-1	Pass
NVNT	ax80	6785	Ant3	-10.79	6.62	-4.05	-1	Pass
NVNT	ax80	6865	Ant3	-12.21	6.62	-5.46	-1	Pass
NVNT	ax80	6945	Ant3	-12.65	6.62	-6.03	-1	Pass
NVNT	ax80	7025	Ant3	-9.94	6.62	-3.19	-1	Pass
NVNT	ax80	5985	Ant4	-8.53	6.62	-1.91	-1	Pass
NVNT	ax80	6145	Ant4	-8.07	6.62	-1.45	-1	Pass
NVNT	ax80	6385	Ant4	-7.66	6.62	-1.04	-1	Pass
NVNT	ax80	6465	Ant4	-7.69	6.62	-1.07	-1	Pass
NVNT	ax80	6545	Ant4	-8.61	6.62	-1.88	-1	Pass
NVNT	ax80	6625	Ant4	-7.83	6.62	-1.21	-1	Pass
NVNT	ax80	6705	Ant4	-8.49	6.62	-1.75	-1	Pass
NVNT	ax80	6785	Ant4	-10.09	6.62	-3.37	-1	Pass
NVNT	ax80	6865	Ant4	-11.45	6.62	-4.83	-1	Pass
NVNT	ax80	6945	Ant4	-12.2	6.62	-5.58	-1	Pass
NVNT	ax80	7025	Ant4	-9.56	6.62	-2.82	-1	Pass
NVNT	ax80	5985	Ant1	-20.55	6.62	-13.79	-1	Pass
NVNT	ax80	5985	Ant2	-21.38	6.62	-14.62	-1	Pass
NVNT	ax80	5985	Ant3	-26.68	6.62	-19.92	-1	Pass
NVNT	ax80	5985	Ant4	-24.78	6.62	-18.02	-1	Pass
NVNT	ax80	5985	Sum	-16.66	12.64	-4.02	-1	Pass
NVNT	ax80	6145	Ant1	-22.91	6.62	-16.19	-1	Pass
NVNT	ax80	6145	Ant2	-23.63	6.62	-16.91	-1	Pass
NVNT	ax80	6145	Ant3	-24.63	6.62	-17.91	-1	Pass
NVNT	ax80	6145	Ant4	-22.38	6.62	-15.66	-1	Pass
NVNT	ax80	6145	Sum	-17.29	12.64	-4.65	-1	Pass
NVNT	ax80	6385	Ant1	-26.09	6.62	-19.36	-1	Pass
NVNT	ax80	6385	Ant2	-27.73	6.62	-21	-1	Pass
NVNT	ax80	6385	Ant3	-27.65	6.62	-20.92	-1	Pass
NVNT	ax80	6385	Ant4	-25.86	6.62	-19.13	-1	Pass
NVNT	ax80	6385	Sum	-20.73	12.64	-8.09	-1	Pass
NVNT	ax80	6465	Ant1	-25.01	6.62	-18.39	-1	Pass
NVNT	ax80	6465	Ant2	-25.42	6.62	-18.8	-1	Pass
NVNT	ax80	6465	Ant3	-27.96	6.62	-21.34	-1	Pass
NVNT	ax80	6465	Ant4	-26.06	6.62	-19.44	-1	Pass
NVNT	ax80	6465	Sum	-19.96	12.64	-7.32	-1	Pass
NVNT	ax80	6545	Ant1	-25.36	6.62	-18.74	-1	Pass
NVNT	ax80	6545	Ant2	-26.47	6.62	-19.85	-1	Pass
NVNT	ax80	6545	Ant3	-28.19	6.62	-21.57	-1	Pass
NVNT	ax80	6545	Ant4	-26.9	6.62	-20.28	-1	Pass

NVNT	ax80	6545	Sum	-20.59	12.64	-7.95	-1	Pass
NVNT	ax80	6625	Ant1	-26.81	6.62	-20.09	-1	Pass
NVNT	ax80	6625	Ant2	-24.89	6.62	-18.17	-1	Pass
NVNT	ax80	6625	Ant3	-28.05	6.62	-21.33	-1	Pass
NVNT	ax80	6625	Ant4	-27.37	6.62	-20.65	-1	Pass
NVNT	ax80	6625	Sum	-20.59	12.64	-7.95	-1	Pass
NVNT	ax80	6705	Ant1	-26.18	6.62	-19.46	-1	Pass
NVNT	ax80	6705	Ant2	-23.21	6.62	-16.49	-1	Pass
NVNT	ax80	6705	Ant3	-26.8	6.62	-20.08	-1	Pass
NVNT	ax80	6705	Ant4	-26.16	6.62	-19.44	-1	Pass
NVNT	ax80	6705	Sum	-19.32	12.64	-6.68	-1	Pass
NVNT	ax80	6785	Ant1	-29.44	6.62	-22.82	-1	Pass
NVNT	ax80	6785	Ant2	-25.98	6.62	-19.36	-1	Pass
NVNT	ax80	6785	Ant3	-30.35	6.62	-23.73	-1	Pass
NVNT	ax80	6785	Ant4	-28.82	6.62	-22.2	-1	Pass
NVNT	ax80	6785	Sum	-22.29	12.64	-9.65	-1	Pass
NVNT	ax80	6865	Ant1	-29.09	6.62	-22.47	-1	Pass
NVNT	ax80	6865	Ant2	-28.66	6.62	-22.04	-1	Pass
NVNT	ax80	6865	Ant3	-30.44	6.62	-23.82	-1	Pass
NVNT	ax80	6865	Ant4	-29.33	6.62	-22.71	-1	Pass
NVNT	ax80	6865	Sum	-23.31	12.64	-10.67	-1	Pass
NVNT	ax80	6945	Ant1	-31.41	6.62	-24.79	-1	Pass
NVNT	ax80	6945	Ant2	-32.49	6.62	-25.87	-1	Pass
NVNT	ax80	6945	Ant3	-32.94	6.62	-26.32	-1	Pass
NVNT	ax80	6945	Ant4	-31.32	6.62	-24.7	-1	Pass
NVNT	ax80	6945	Sum	-25.96	12.64	-12.32	-1	Pass
NVNT	ax80	7025	Ant1	-31.47	6.62	-24.85	-1	Pass
NVNT	ax80	7025	Ant2	-33.24	6.62	-26.62	-1	Pass
NVNT	ax80	7025	Ant3	-31.76	6.62	-25.14	-1	Pass
NVNT	ax80	7025	Ant4	-29.35	6.62	-22.73	-1	Pass
NVNT	ax80	7025	Sum	-25.21	12.64	-12.57	-1	Pass
NVNT	ax160	6025	Ant1	-9.01	6.62	-2.39	-1	Pass
NVNT	ax160	6185	Ant1	-8.07	6.62	-1.45	-1	Pass
NVNT	ax160	6345	Ant1	-7.95	6.62	-1.2	-1	Pass
NVNT	ax160	6505	Ant1	-11.97	6.62	-5.35	-1	Pass
NVNT	ax160	6665	Ant1	-9.01	6.62	-2.25	-1	Pass
NVNT	ax160	6825	Ant1	-12.23	6.62	-5.5	-1	Pass
NVNT	ax160	6985	Ant1	-9.56	6.62	-2.94	-1	Pass
NVNT	ax160	6025	Ant2	-8.23	6.62	-1.61	-1	Pass
NVNT	ax160	6185	Ant2	-8.6	6.62	-1.87	-1	Pass
NVNT	ax160	6345	Ant2	-7.72	6.62	-1.1	-1	Pass
NVNT	ax160	6505	Ant2	-8.42	6.62	-1.8	-1	Pass
NVNT	ax160	6665	Ant2	-8.82	6.62	-2.07	-1	Pass
NVNT	ax160	6825	Ant2	-11.98	6.62	-5.19	-1	Pass

NVNT	ax160	6985	Ant2	-10.18	6.62	-3.56	-1	Pass
NVNT	ax160	6025	Ant3	-10.13	6.62	-3.39	-1	Pass
NVNT	ax160	6185	Ant3	-8	6.62	-1.38	-1	Pass
NVNT	ax160	6345	Ant3	-7.84	6.62	-1.22	-1	Pass
NVNT	ax160	6505	Ant3	-9.55	6.62	-2.81	-1	Pass
NVNT	ax160	6665	Ant3	-9.22	6.62	-2.6	-1	Pass
NVNT	ax160	6825	Ant3	-11.74	6.62	-5.02	-1	Pass
NVNT	ax160	6985	Ant3	-12.63	6.62	-6.01	-1	Pass
NVNT	ax160	6025	Ant4	-10.29	6.62	-3.54	-1	Pass
NVNT	ax160	6185	Ant4	-7.67	6.62	-1.05	-1	Pass
NVNT	ax160	6345	Ant4	-8.46	6.62	-1.72	-1	Pass
NVNT	ax160	6505	Ant4	-8.29	6.62	-1.55	-1	Pass
NVNT	ax160	6665	Ant4	-8.29	6.62	-1.67	-1	Pass
NVNT	ax160	6825	Ant4	-11.62	6.62	-4.86	-1	Pass
NVNT	ax160	6985	Ant4	-9.69	6.62	-3.07	-1	Pass
NVNT	ax160	6025	Ant1	-21.93	6.62	-15.31	-1	Pass
NVNT	ax160	6025	Ant2	-22.49	6.62	-15.87	-1	Pass
NVNT	ax160	6025	Ant3	-26.83	6.62	-20.21	-1	Pass
NVNT	ax160	6025	Ant4	-23.57	6.62	-16.95	-1	Pass
NVNT	ax160	6025	Sum	-17.32	12.64	-4.68	-1	Pass
NVNT	ax160	6185	Ant1	-24.37	6.62	-17.59	-1	Pass
NVNT	ax160	6185	Ant2	-24.87	6.62	-18.09	-1	Pass
NVNT	ax160	6185	Ant3	-25.82	6.62	-19.04	-1	Pass
NVNT	ax160	6185	Ant4	-23.58	6.62	-16.8	-1	Pass
NVNT	ax160	6185	Sum	-18.56	12.64	-5.92	-1	Pass
NVNT	ax160	6345	Ant1	-25.72	6.62	-18.97	-1	Pass
NVNT	ax160	6345	Ant2	-26.91	6.62	-20.16	-1	Pass
NVNT	ax160	6345	Ant3	-27.75	6.62	-21	-1	Pass
NVNT	ax160	6345	Ant4	-25.54	6.62	-18.79	-1	Pass
NVNT	ax160	6345	Sum	-20.37	12.64	-7.73	-1	Pass
NVNT	ax160	6505	Ant1	-26.32	6.62	-19.54	-1	Pass
NVNT	ax160	6505	Ant2	-27.18	6.62	-20.4	-1	Pass
NVNT	ax160	6505	Ant3	-29.02	6.62	-22.24	-1	Pass
NVNT	ax160	6505	Ant4	-27.74	6.62	-20.96	-1	Pass
NVNT	ax160	6505	Sum	-21.44	12.64	-8.80	-1	Pass
NVNT	ax160	6665	Ant1	-26	6.62	-19.38	-1	Pass
NVNT	ax160	6665	Ant2	-23.77	6.62	-17.15	-1	Pass
NVNT	ax160	6665	Ant3	-27.47	6.62	-20.85	-1	Pass
NVNT	ax160	6665	Ant4	-26.17	6.62	-19.55	-1	Pass
NVNT	ax160	6665	Sum	-19.62	1264	-6.98	-1	Pass
NVNT	ax160	6825	Ant1	-28.41	6.62	-21.67	-1	Pass
NVNT	ax160	6825	Ant2	-26.67	6.62	-19.93	-1	Pass
NVNT	ax160	6825	Ant3	-28.72	6.62	-21.98	-1	Pass
NVNT	ax160	6825	Ant4	-28.19	6.62	-21.45	-1	Pass

NVNT	ax160	6825	Sum	-21.90	12.64	-9.26	-1	Pass
NVNT	ax160	6985	Ant1	-29.49	6.62	-22.77	-1	Pass
NVNT	ax160	6985	Ant2	-30.61	6.62	-23.89	-1	Pass
NVNT	ax160	6985	Ant3	-29.81	6.62	-23.09	-1	Pass
NVNT	ax160	6985	Ant4	-27.92	6.62	-21.2	-1	Pass
NVNT	ax160	6985	Sum	-23.32	12.64	-10.68	-1	Pass

Test Graphs


PSD NVNT ax20 5955MHz Ant1




PSD NVNT ax20 6175MHz Ant1




PSD NVNT ax20 6415MHz Ant1

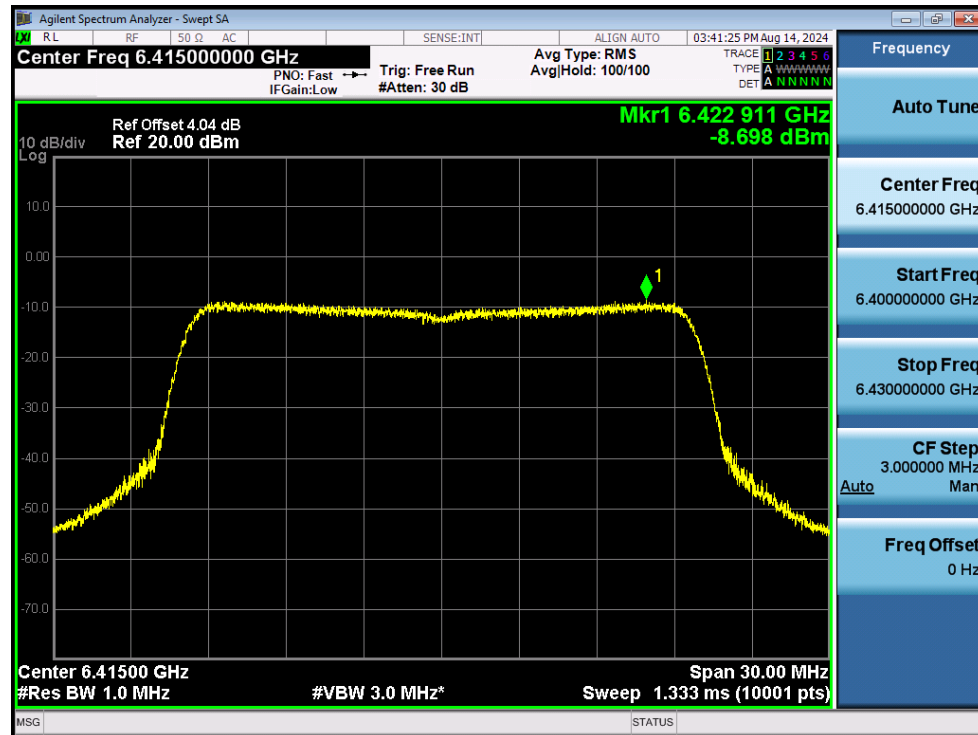


PSD NVNT ax20 6435MHz Ant1

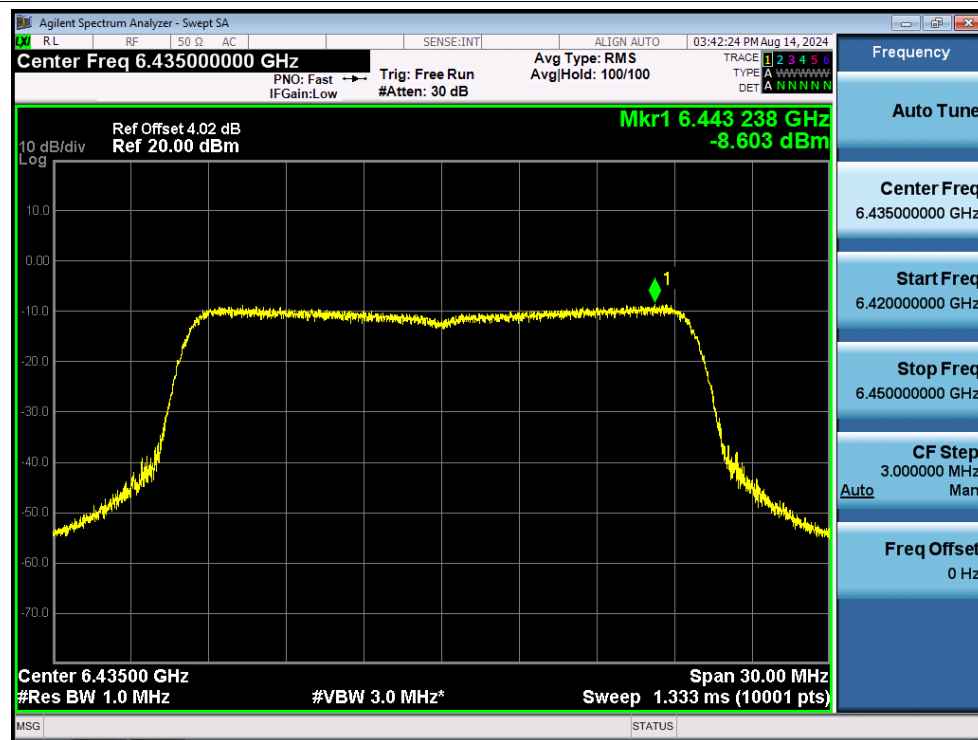


PSD NVNT ax20 6475MHz Ant1

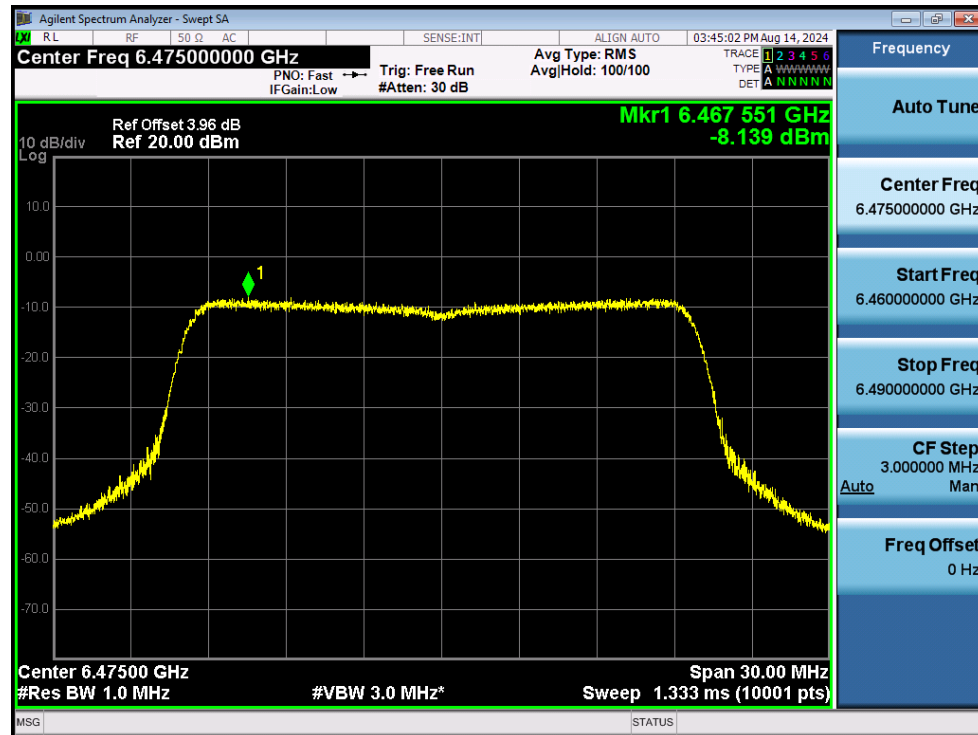


PSD NVNT ax20 6515MHz Ant1

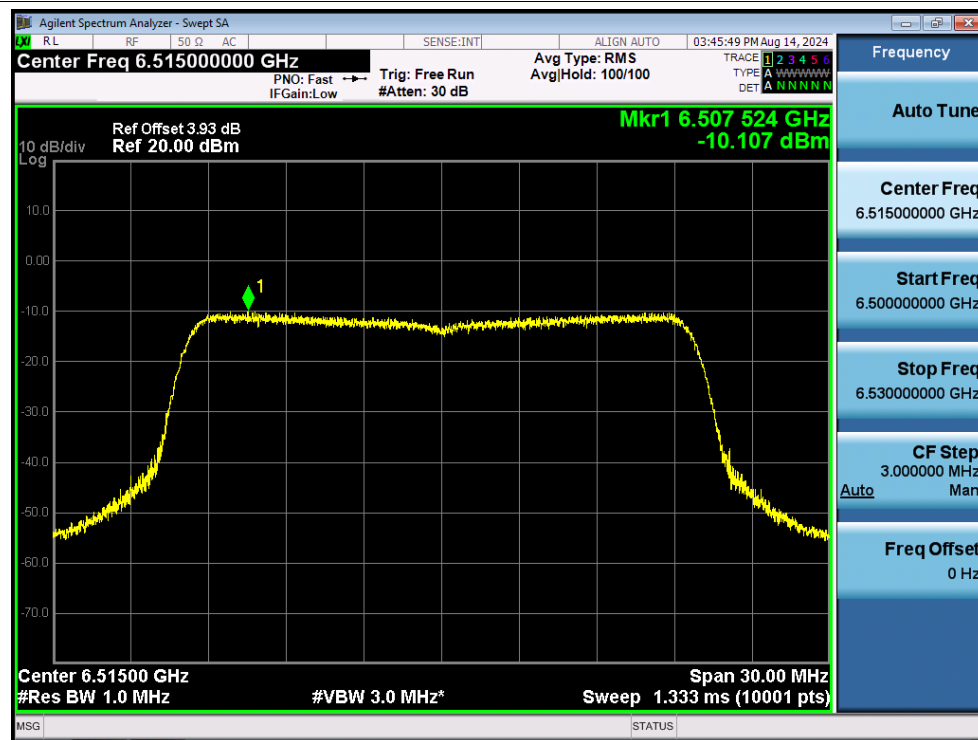


PSD NVNT ax20 6535MHz Ant1

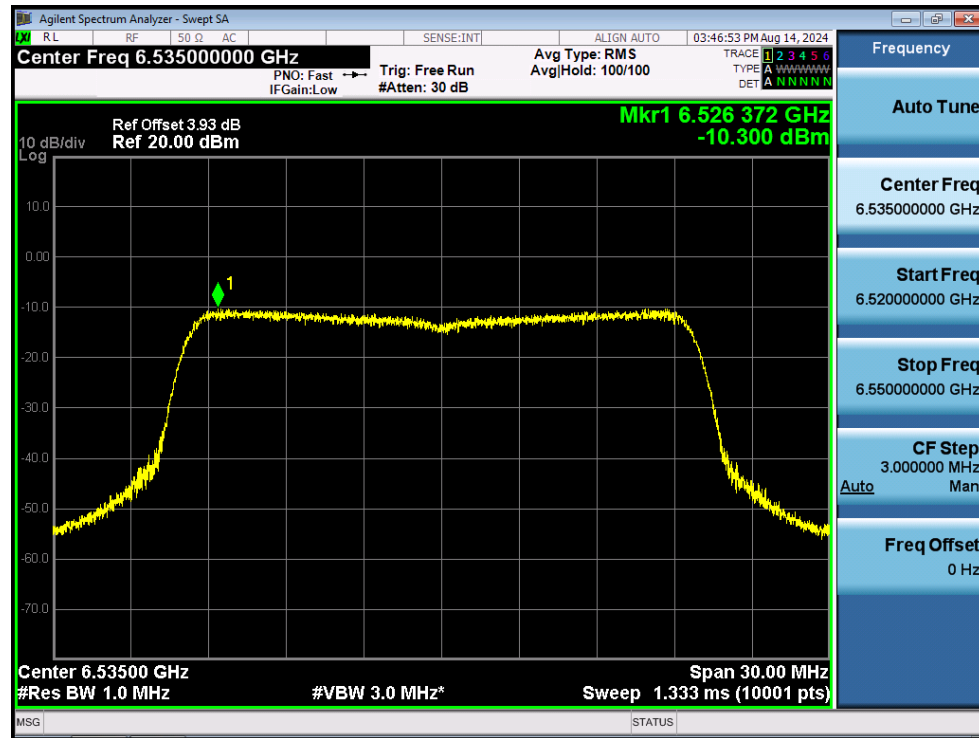


PSD NVNT ax20 6695MHz Ant1

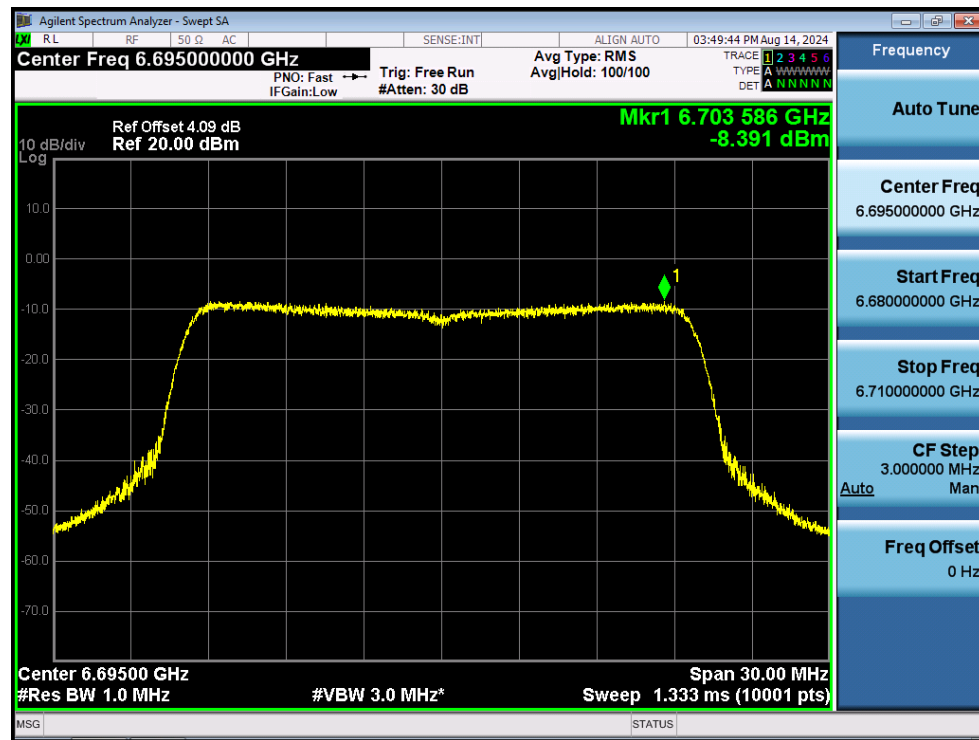


PSD NVNT ax20 6855MHz Ant1

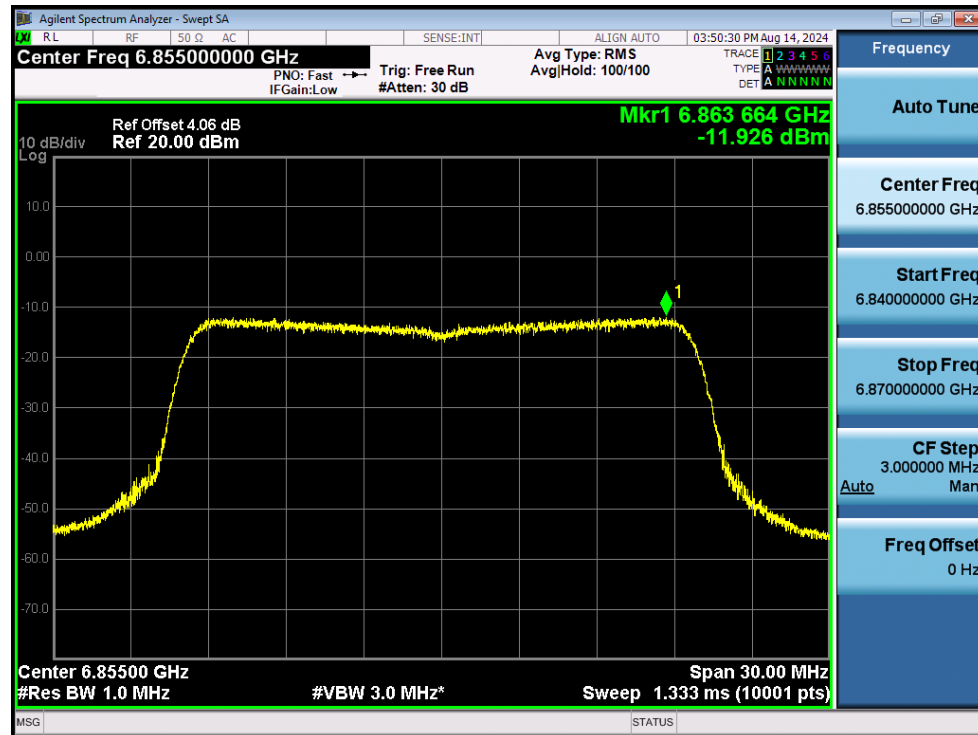


PSD NVNT ax20 6875MHz Ant1

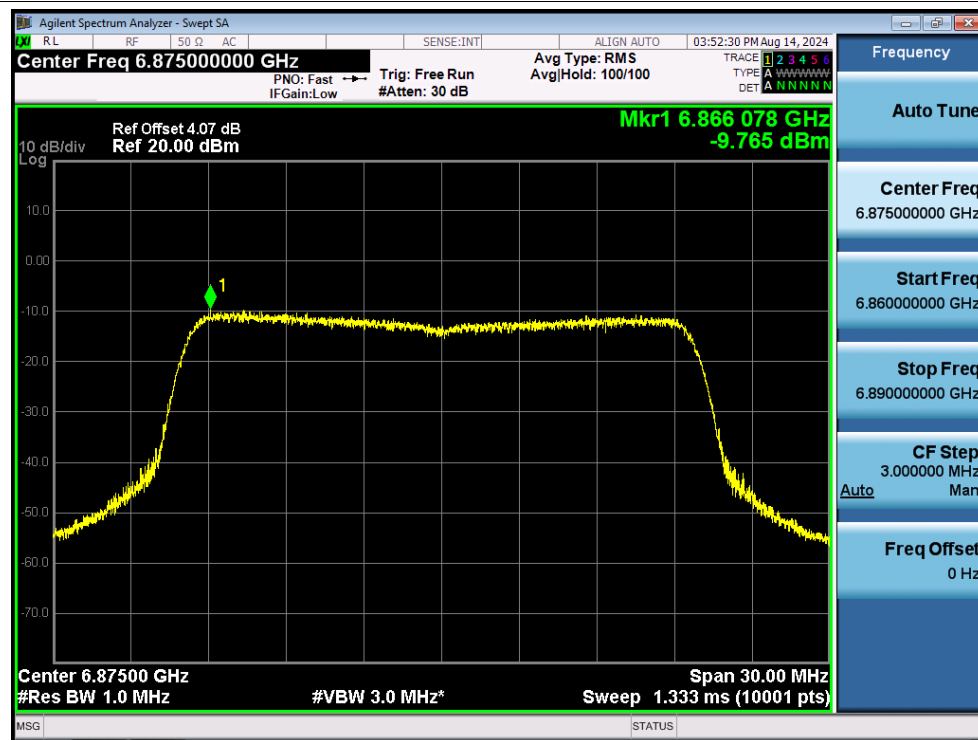


PSD NVNT ax20 6895MHz Ant1

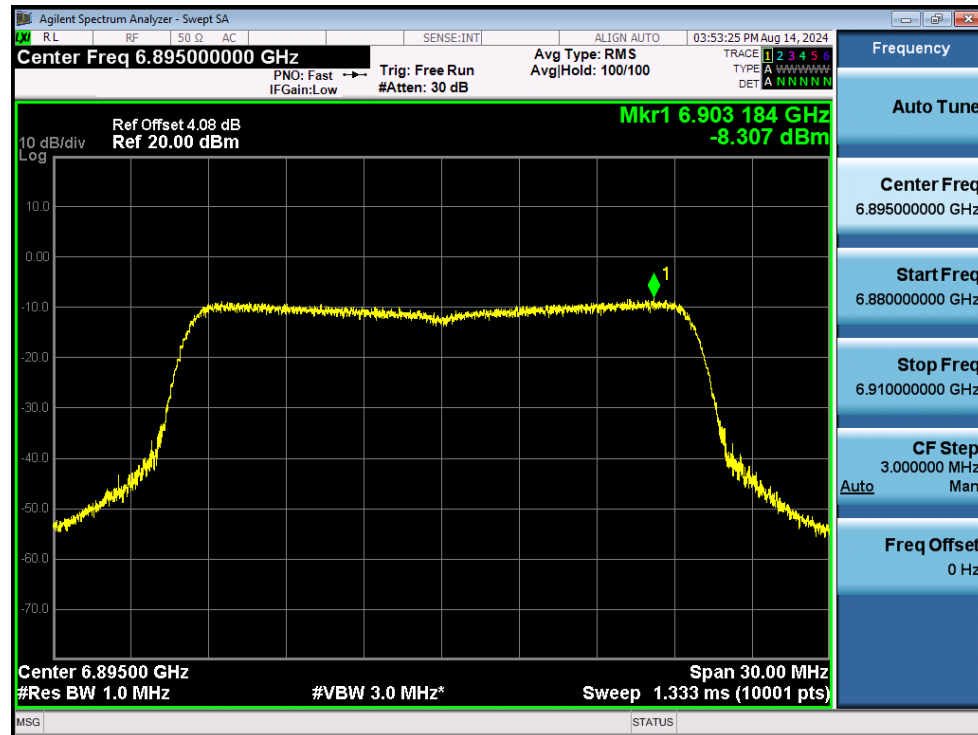


PSD NVNT ax20 6995MHz Ant1

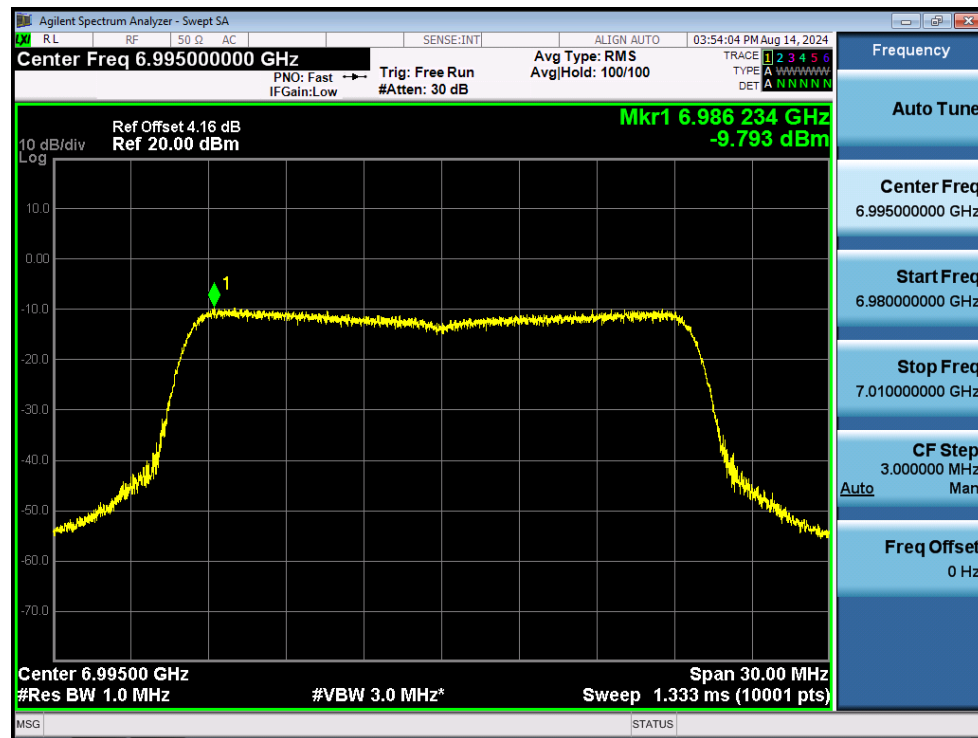

PSD NVNT ax20 7115MHz Ant1

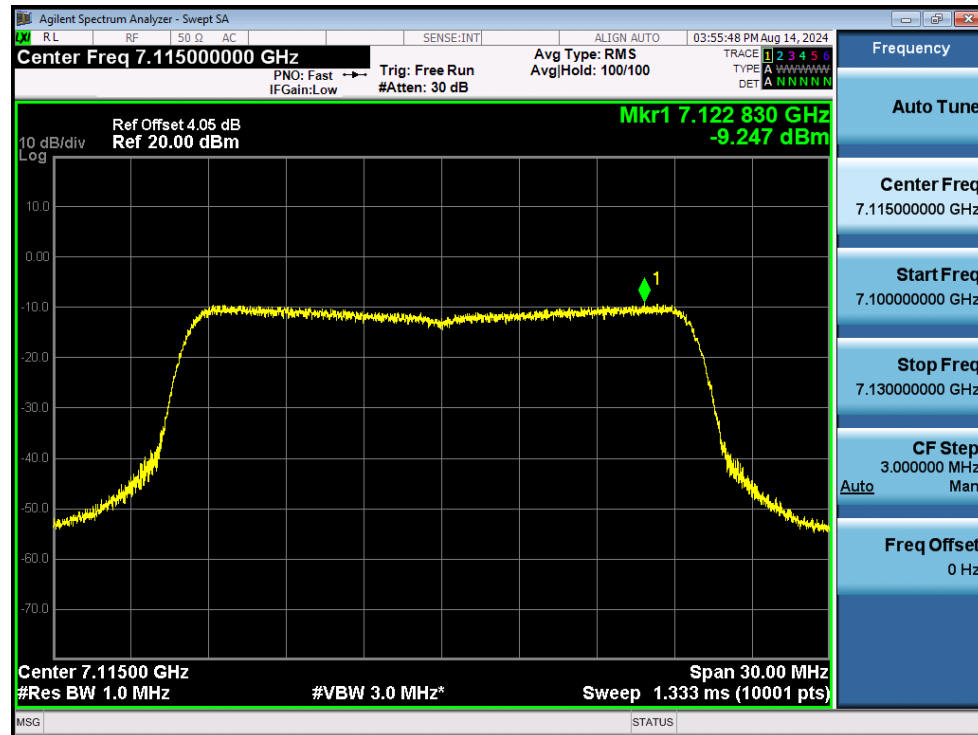


PSD NVNT ax20 5955MHz Ant2

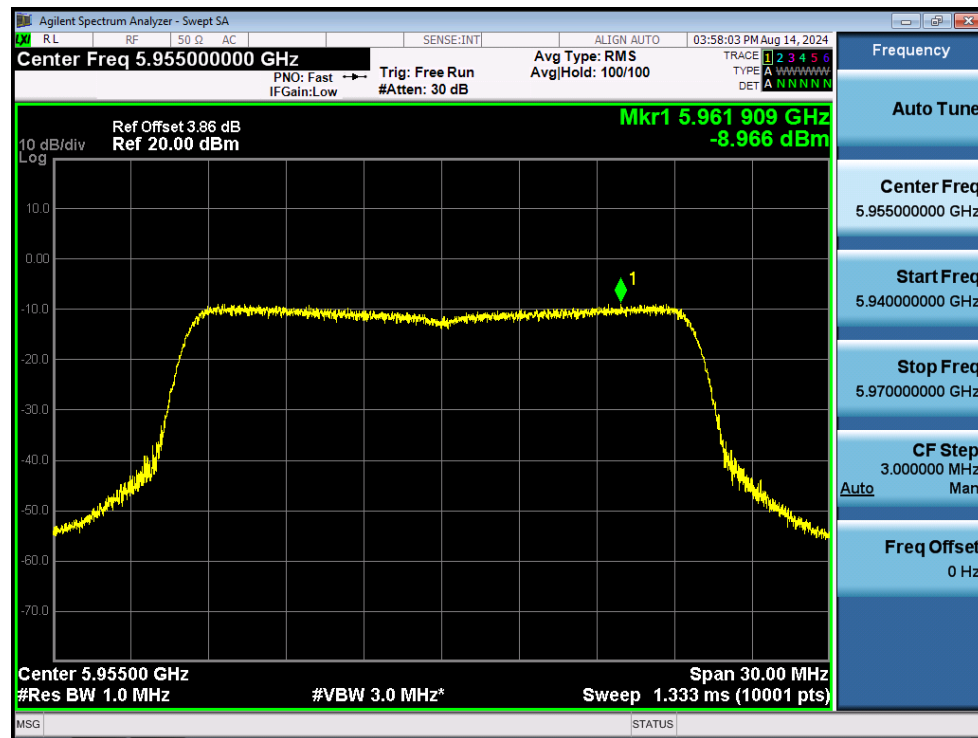


PSD NVNT ax20 6175MHz Ant2




PSD NVNT ax20 6415MHz Ant2

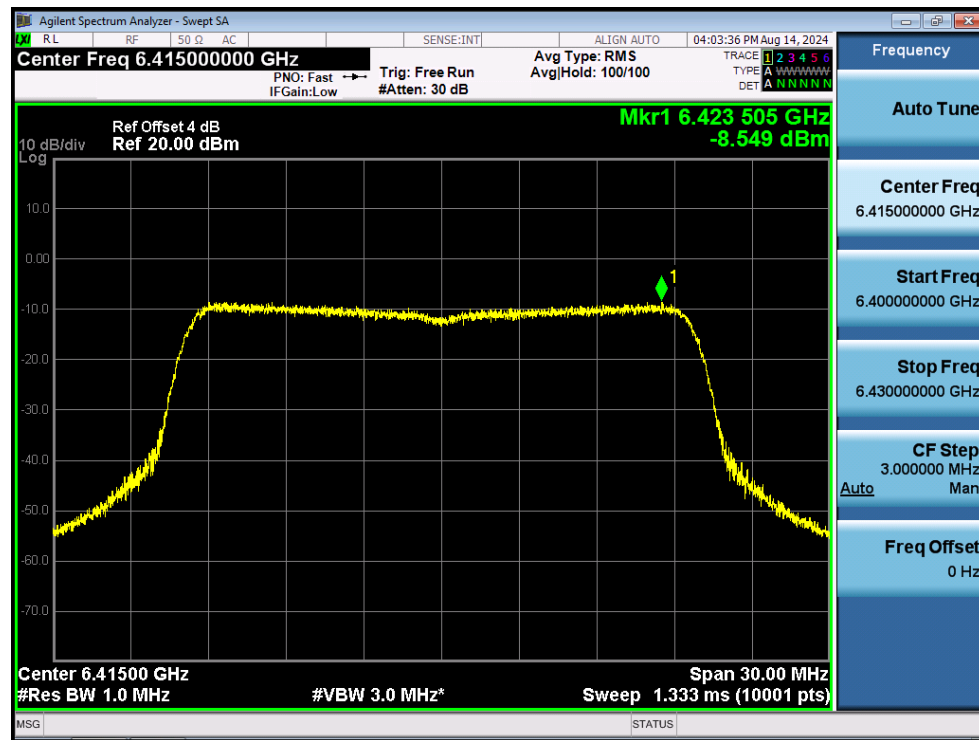


PSD NVNT ax20 6435MHz Ant2

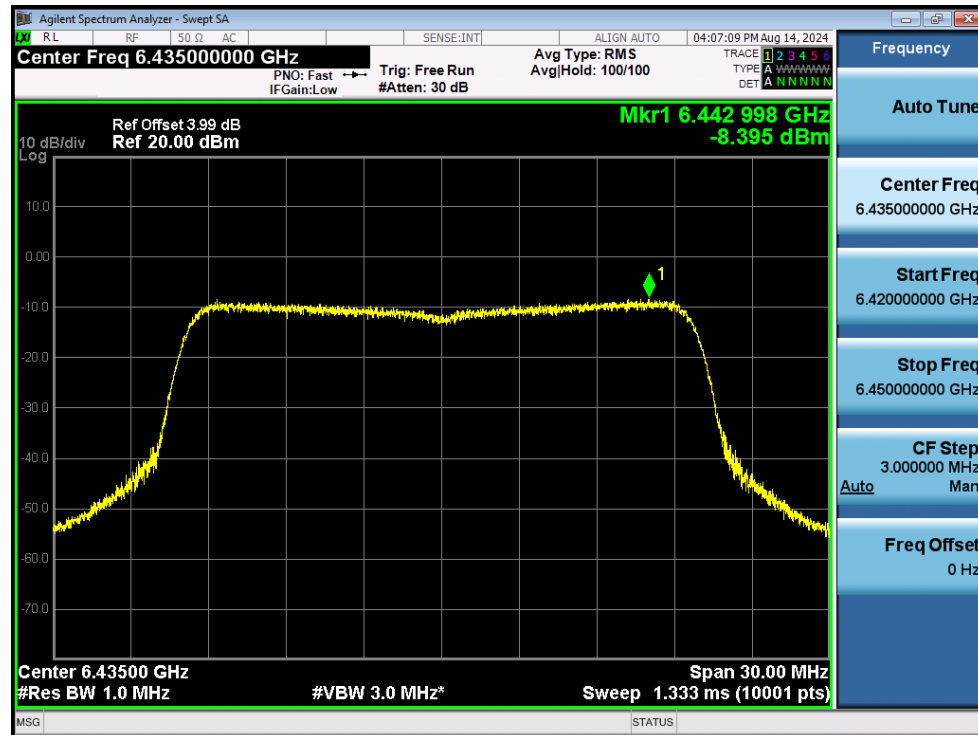


PSD NVNT ax20 6475MHz Ant2

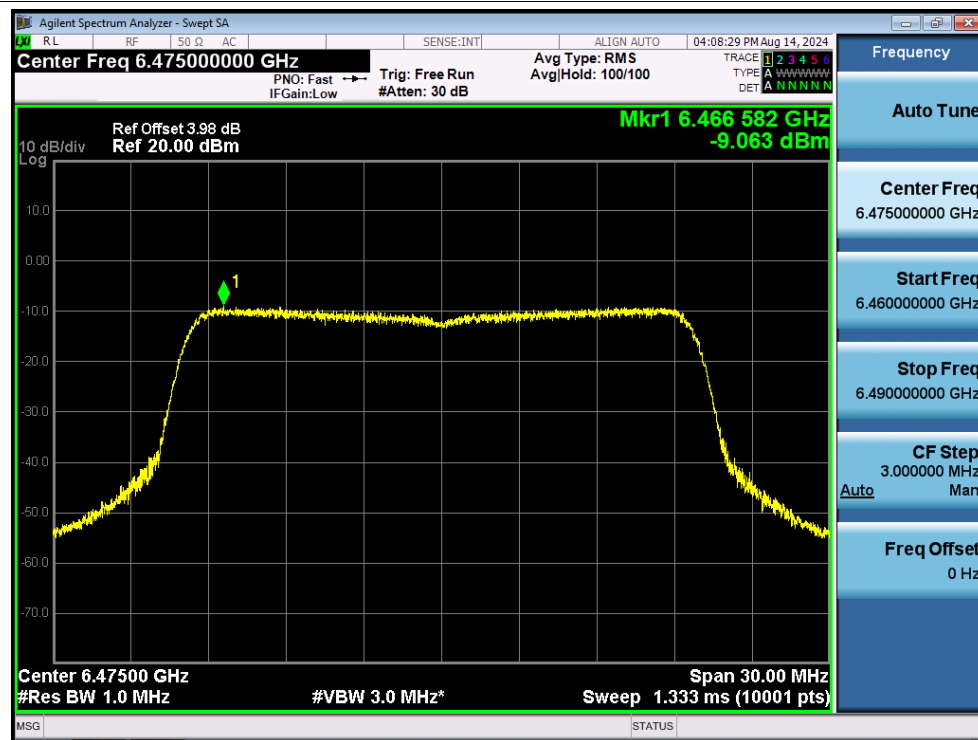


PSD NVNT ax20 6515MHz Ant2

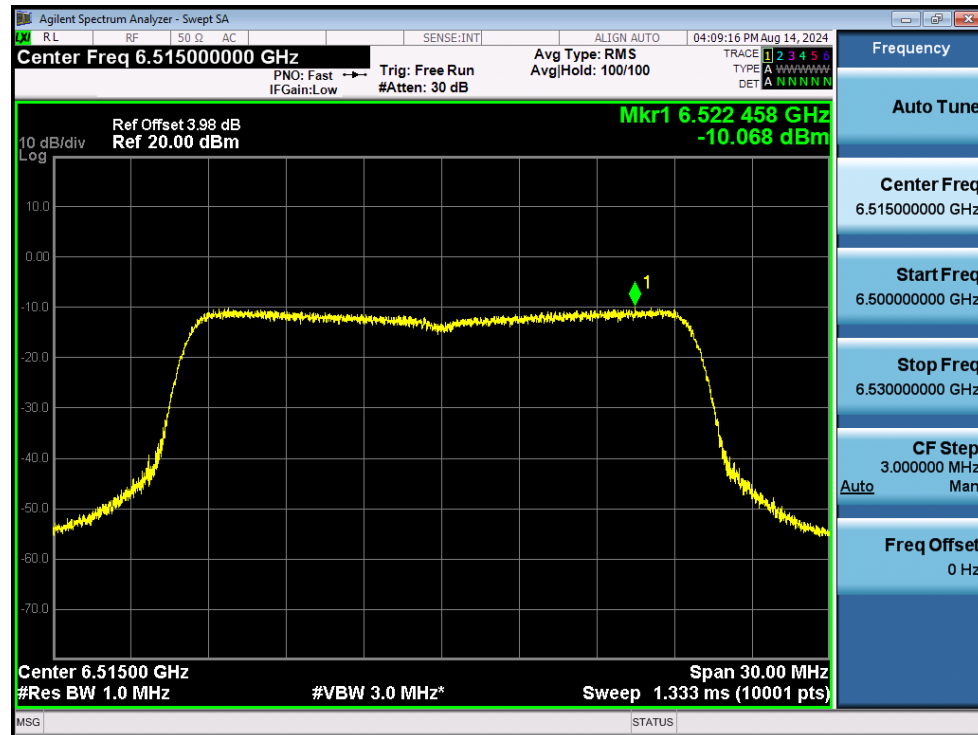


PSD NVNT ax20 6535MHz Ant2

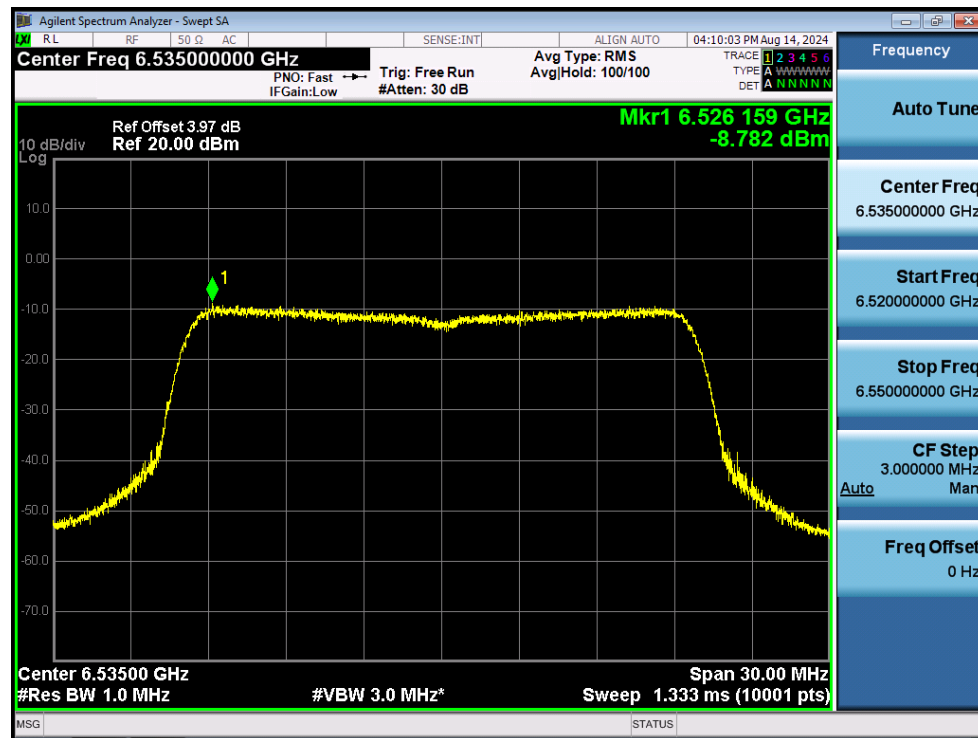


PSD NVNT ax20 6695MHz Ant2

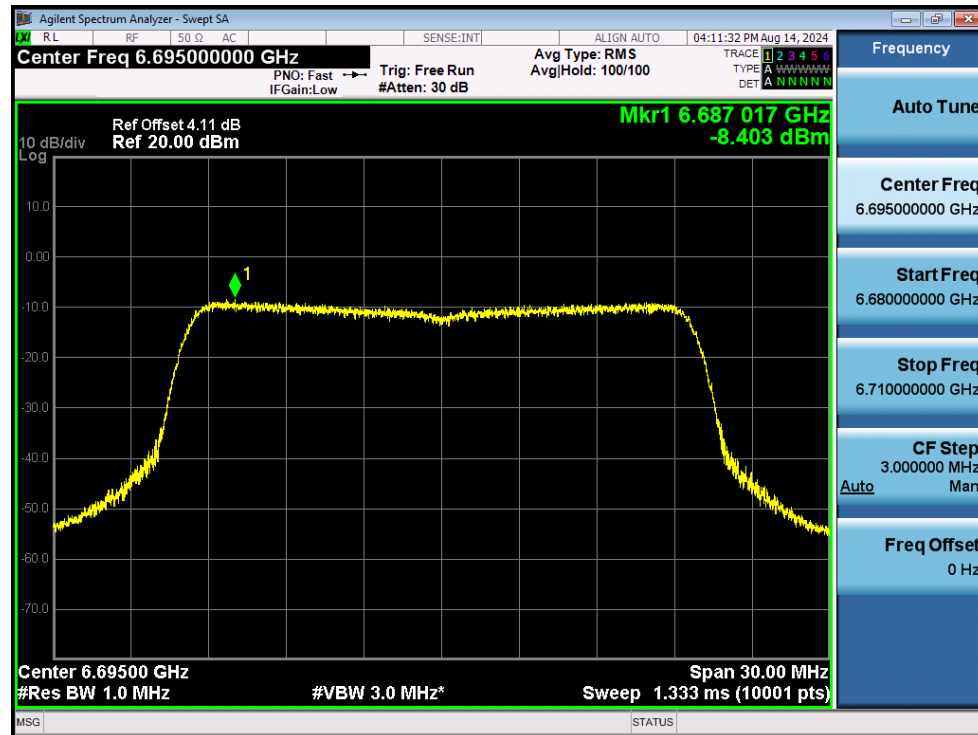


PSD NVNT ax20 6855MHz Ant2

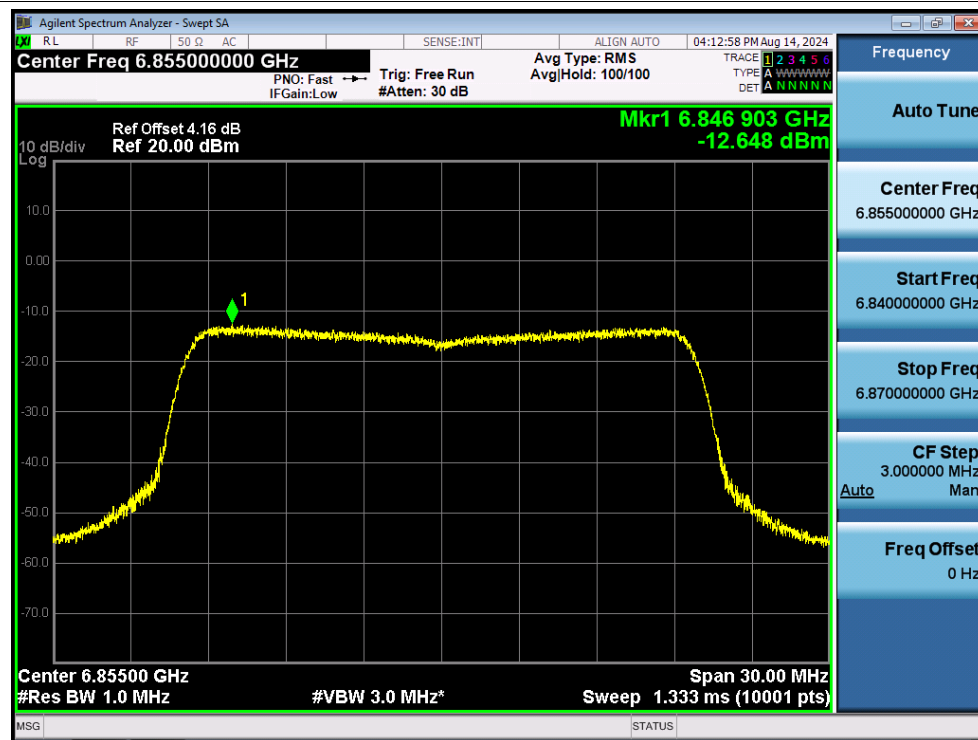


PSD NVNT ax20 6875MHz Ant2

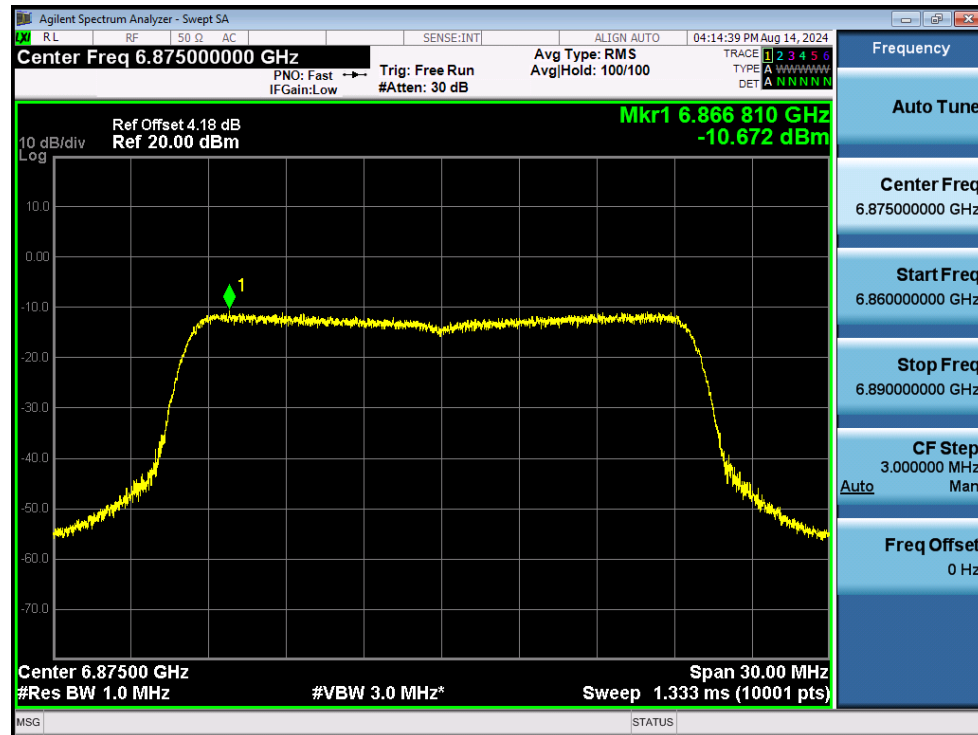


PSD NVNT ax20 6895MHz Ant2

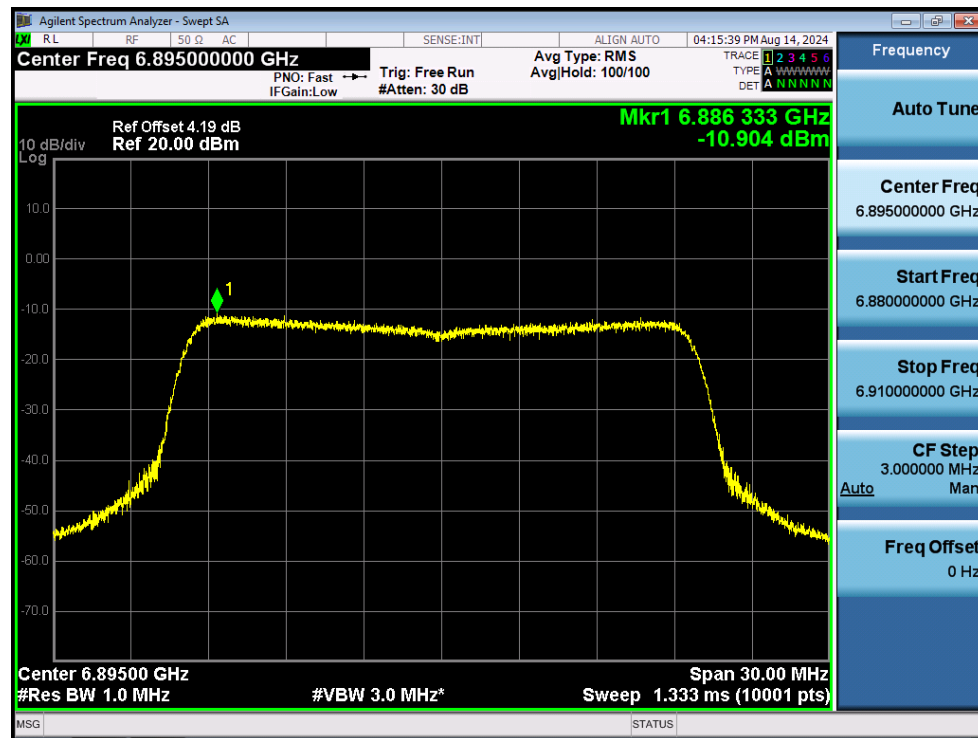


PSD NVNT ax20 6995MHz Ant2

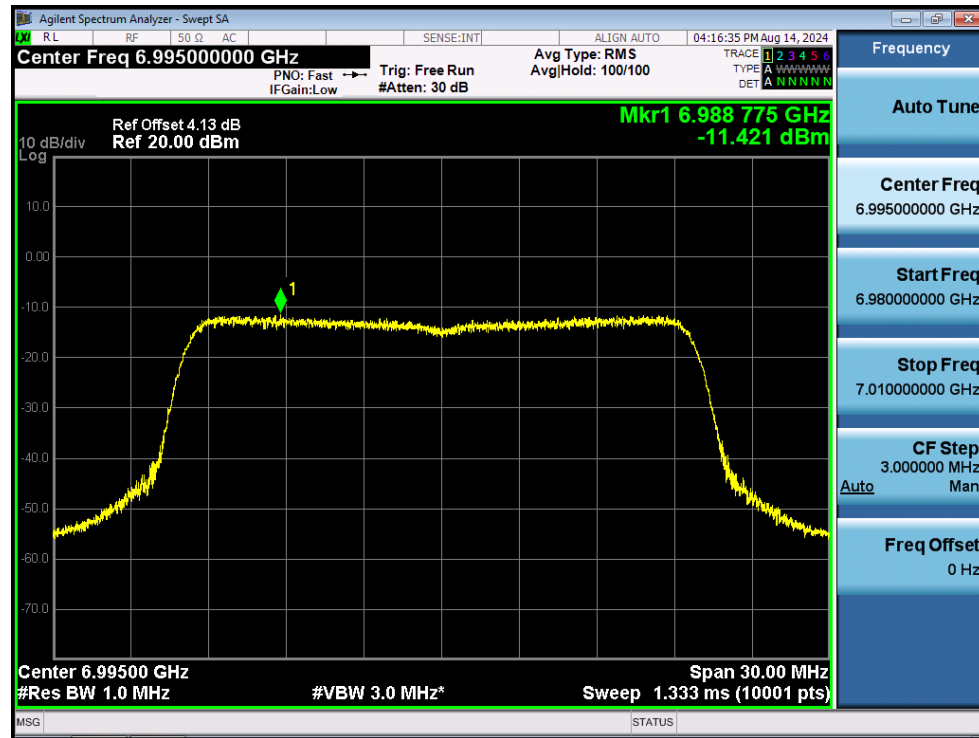

PSD NVNT ax20 7115MHz Ant2

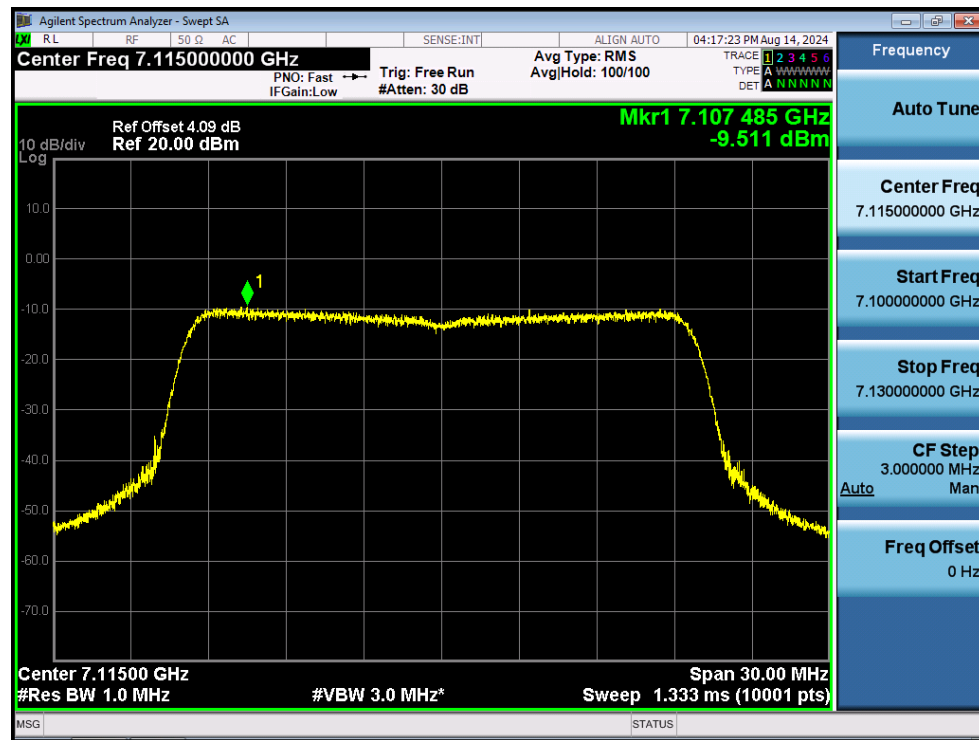

PSD NVNT ax20 5955MHz Ant3

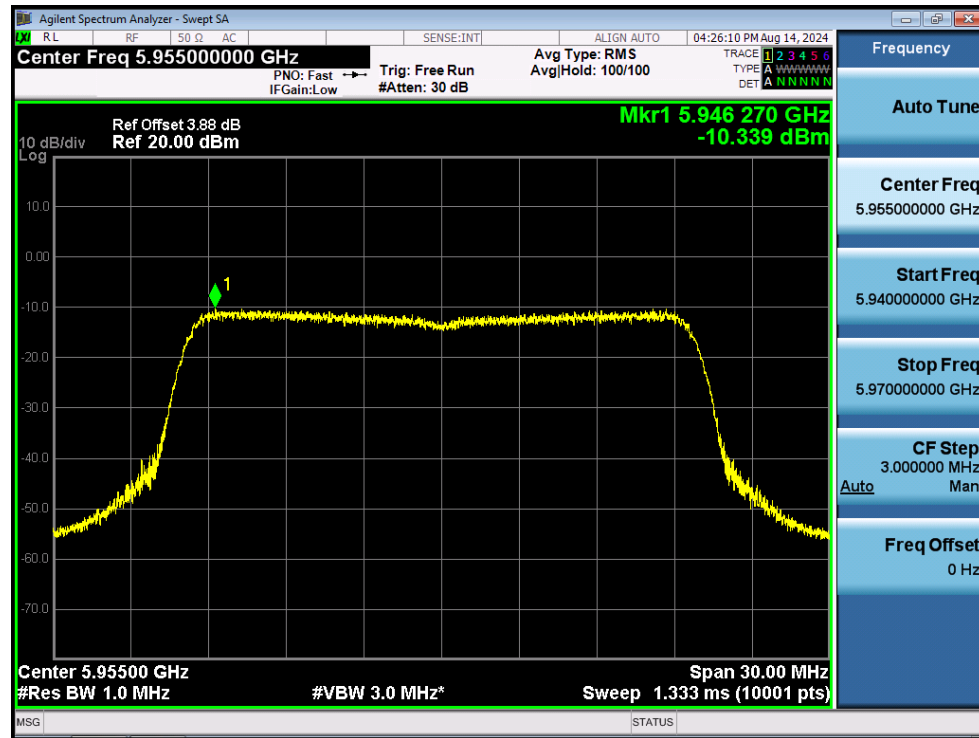


PSD NVNT ax20 6175MHz Ant3




PSD NVNT ax20 6415MHz Ant3




PSD NVNT ax20 6435MHz Ant3

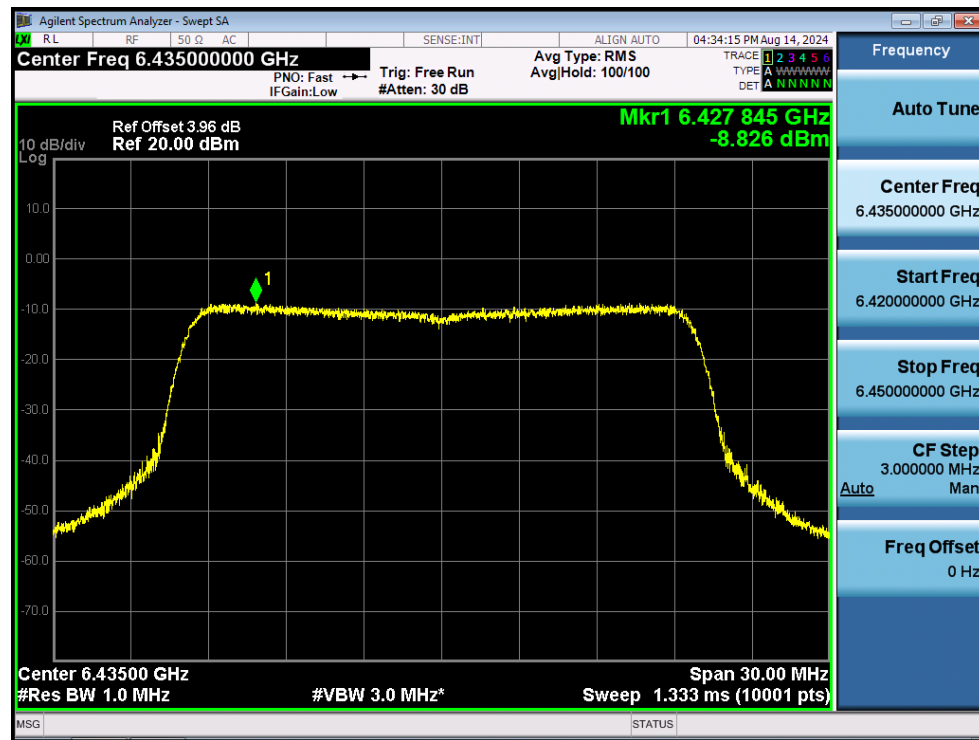


PSD NVNT ax20 6475MHz Ant3

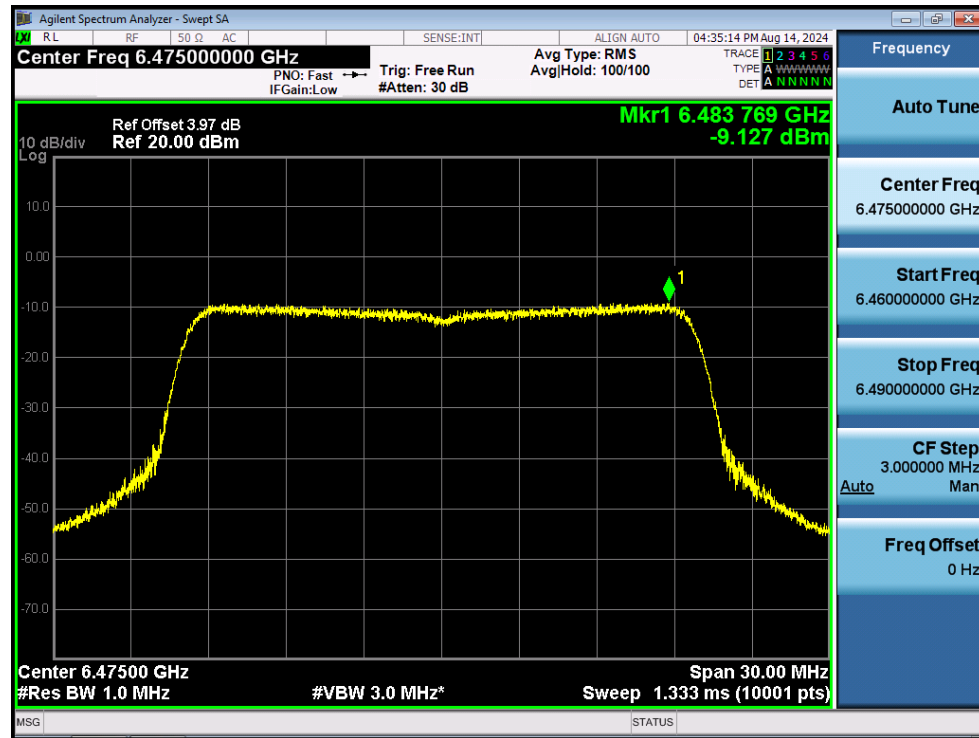

PSD NVNT ax20 6515MHz Ant3

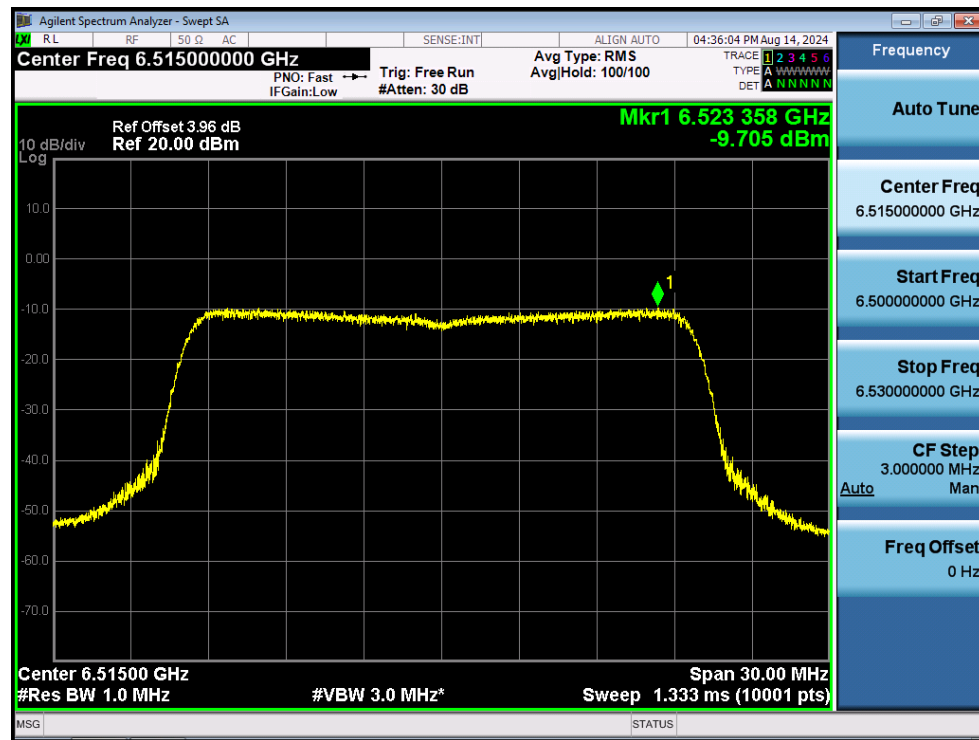


PSD NVNT ax20 6535MHz Ant3

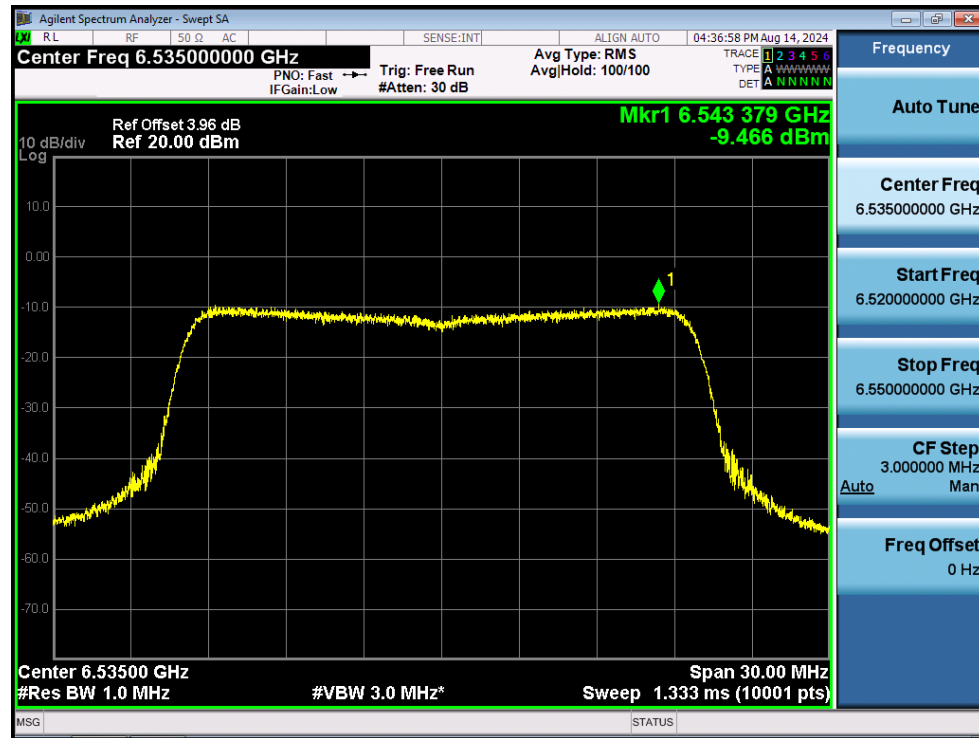


PSD NVNT ax20 6695MHz Ant3




PSD NVNT ax20 6855MHz Ant3

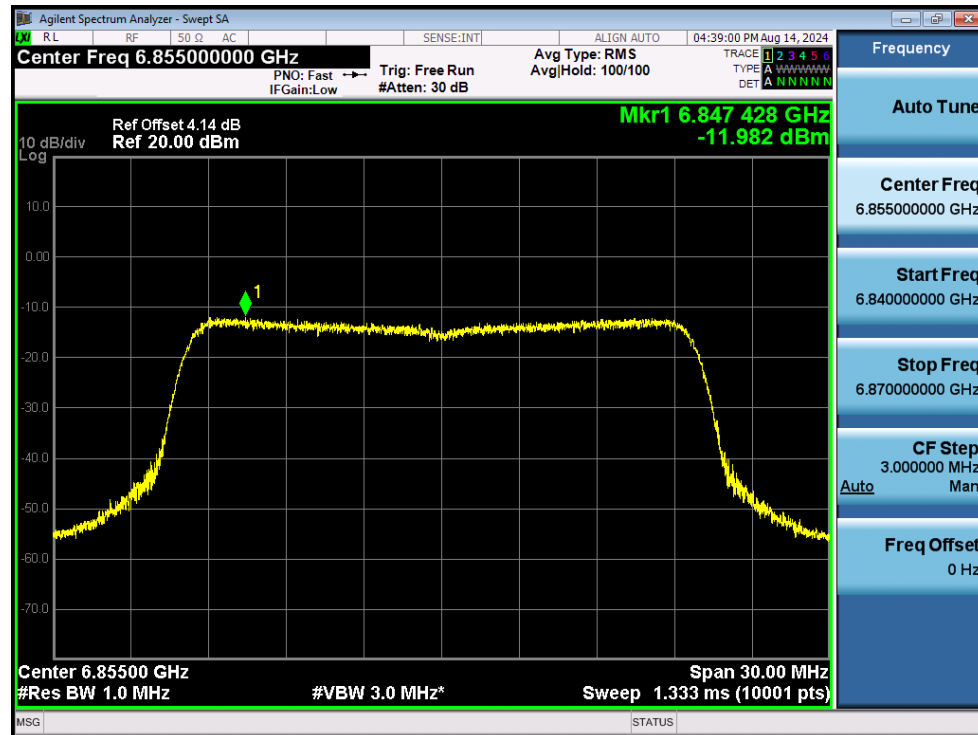


PSD NVNT ax20 6875MHz Ant3

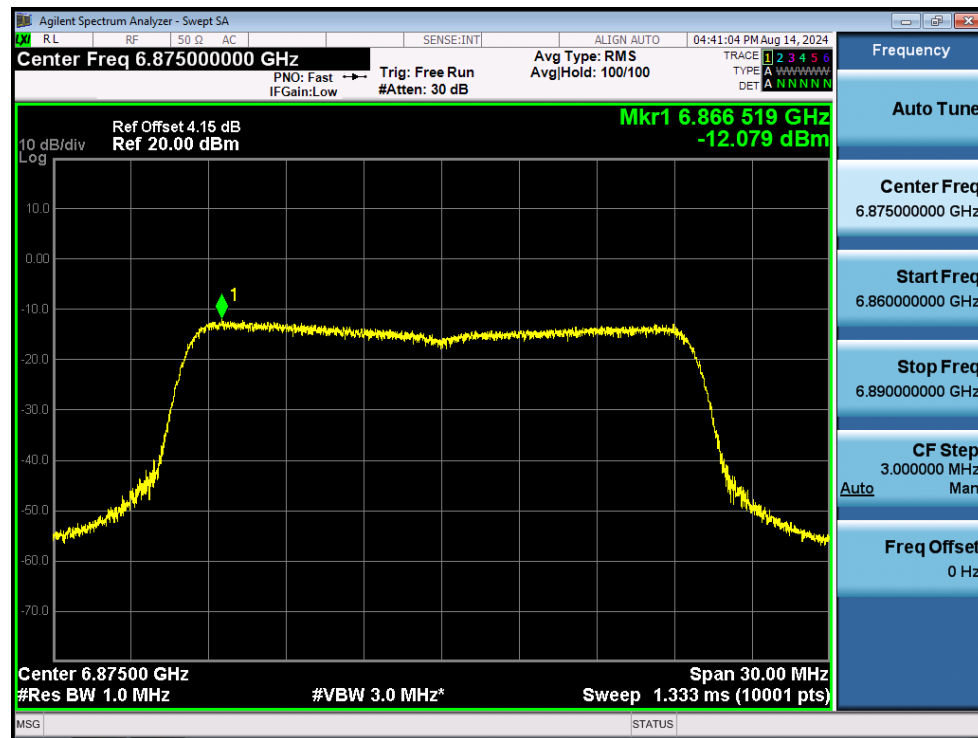


PSD NVNT ax20 6895MHz Ant3

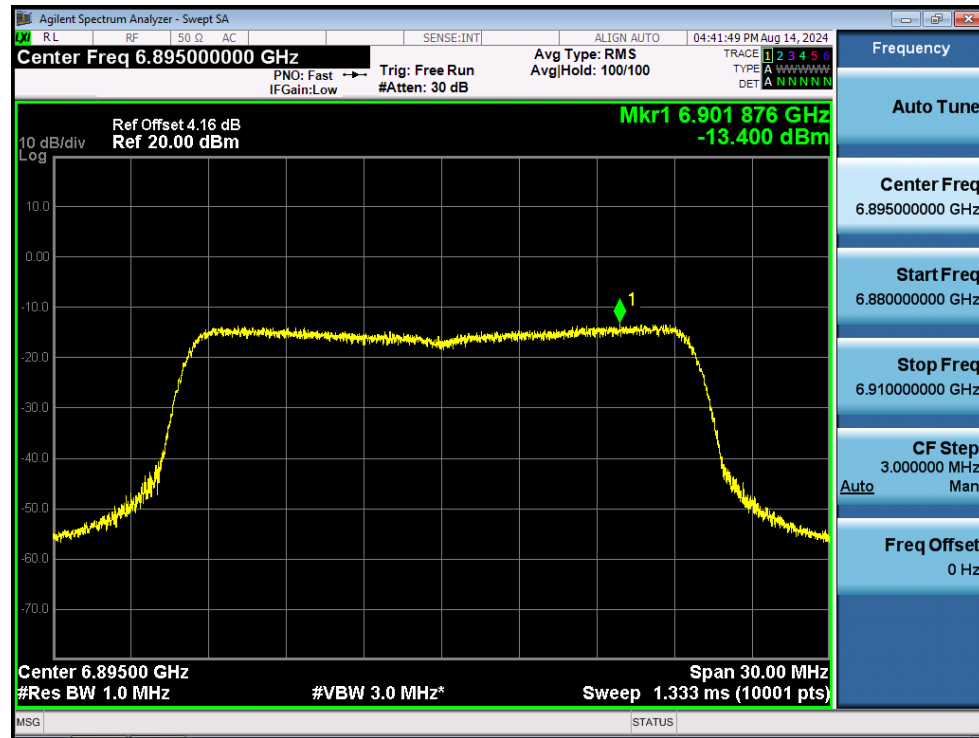


PSD NVNT ax20 6995MHz Ant3

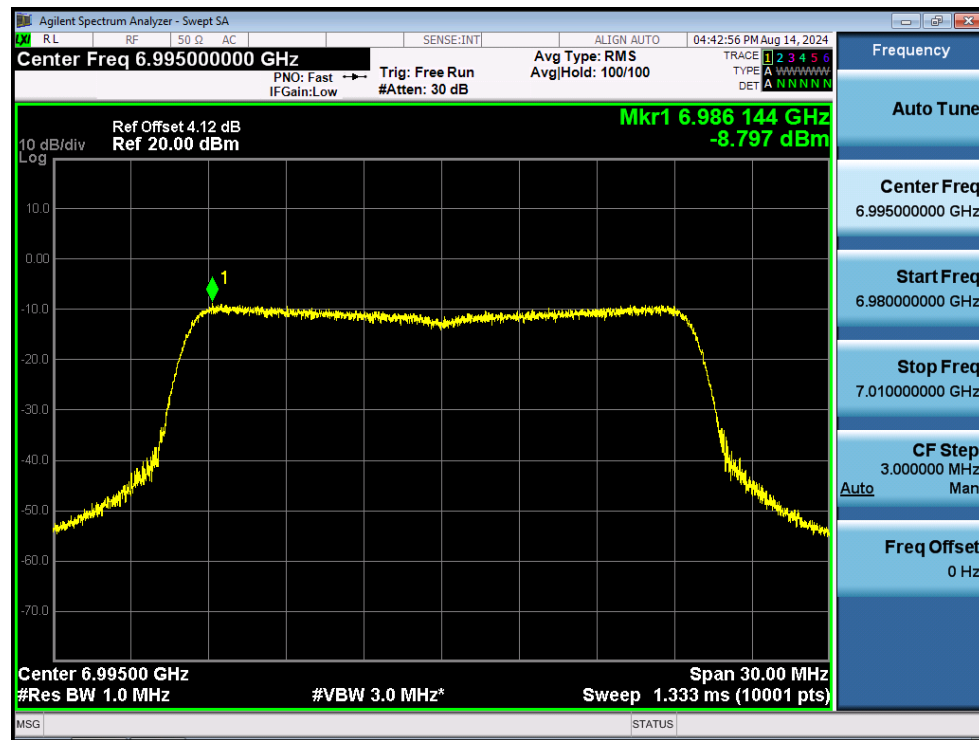

PSD NVNT ax20 7115MHz Ant3

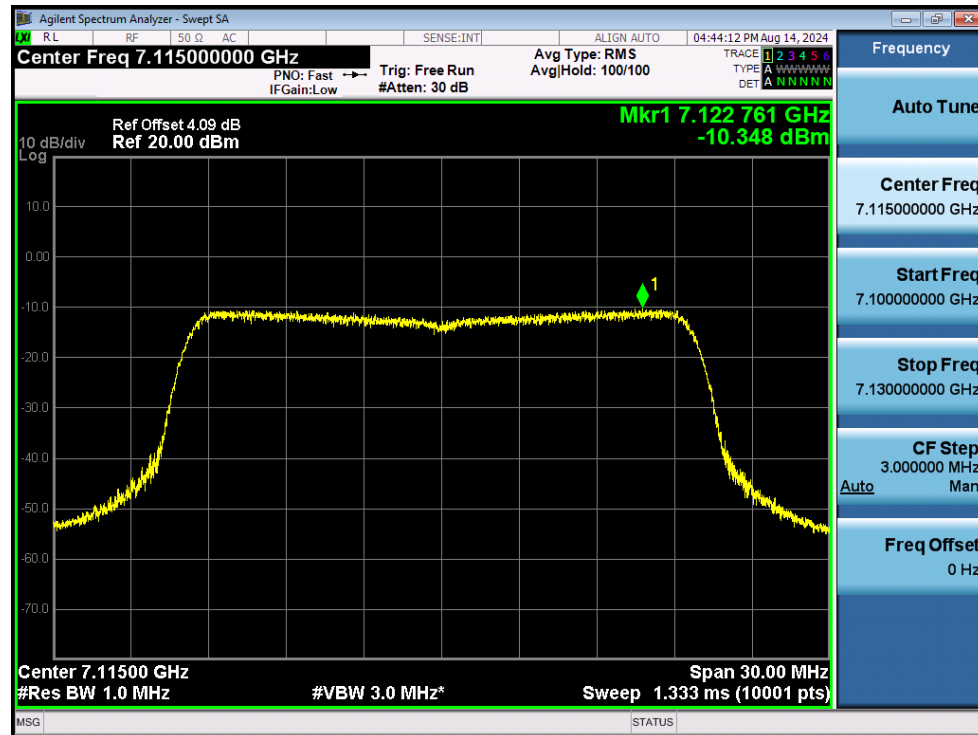


PSD NVNT ax20 5935MHz Ant4

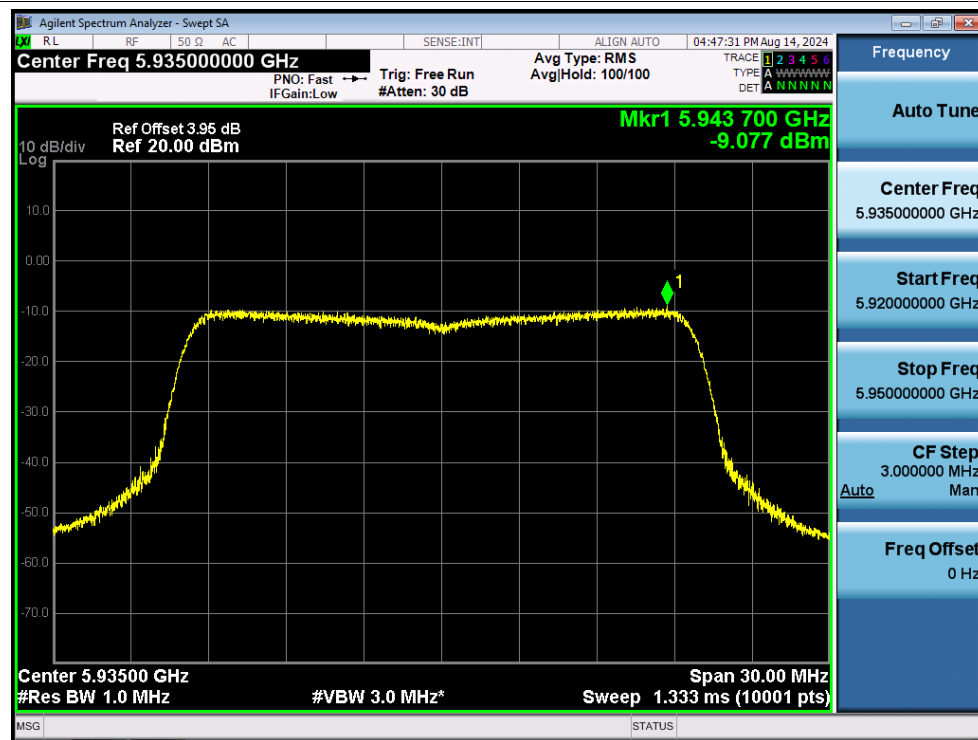


PSD NVNT ax20 6175MHz Ant4




PSD NVNT ax20 6415MHz Ant4

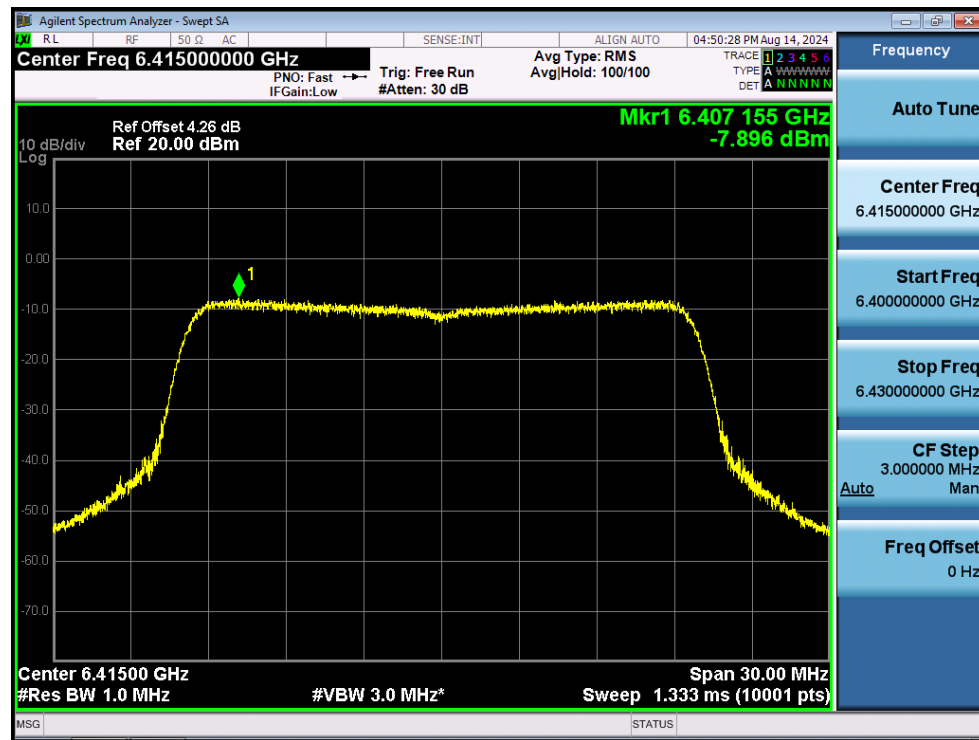

PSD NVNT ax20 6435MHz Ant4

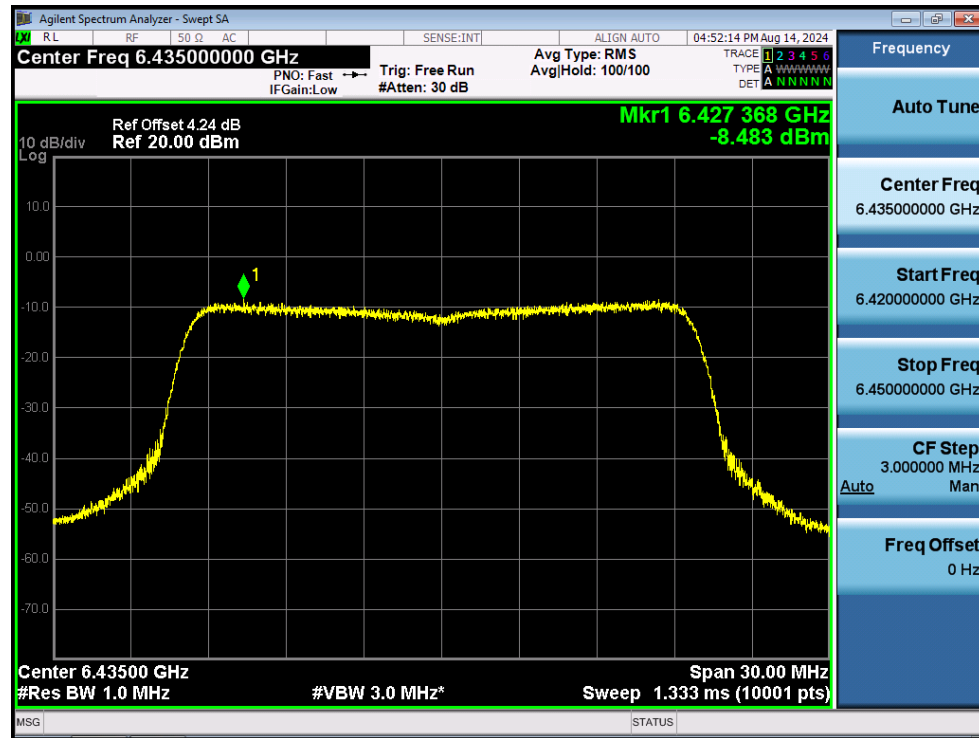


PSD NVNT ax20 6475MHz Ant4

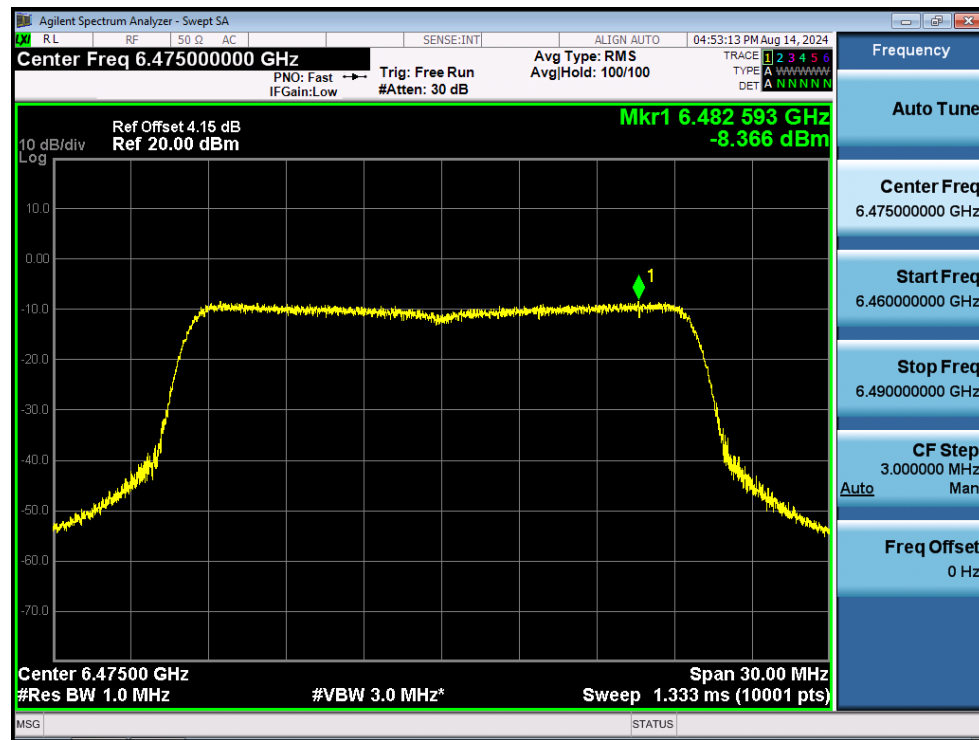


PSD NVNT ax20 6515MHz Ant4




PSD NVNT ax20 6535MHz Ant4

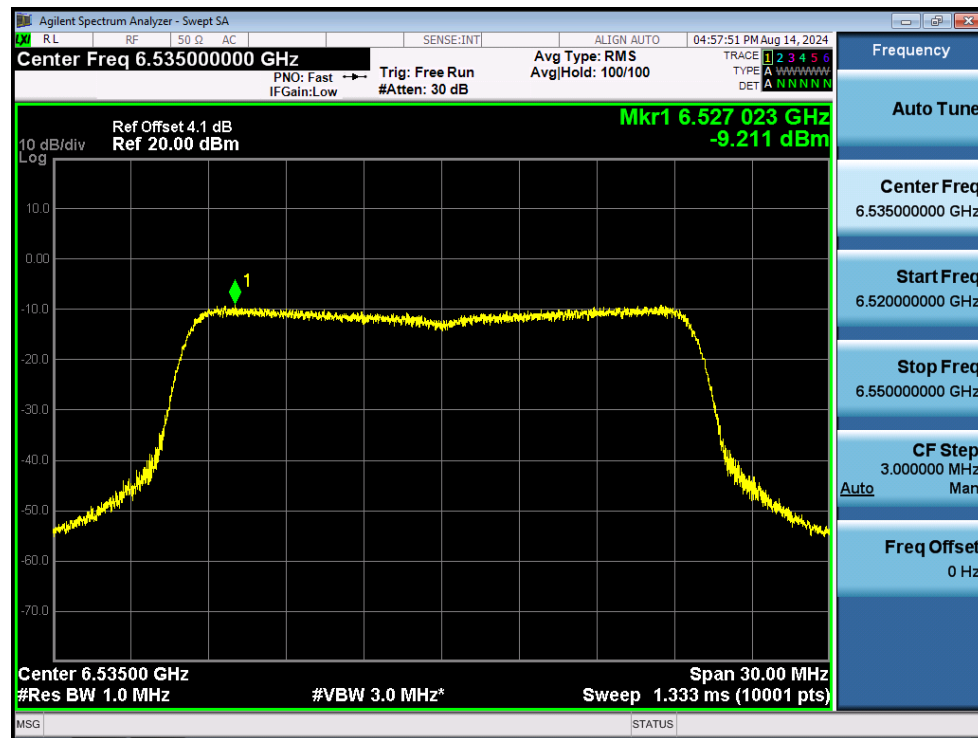


PSD NVNT ax20 6695MHz Ant4

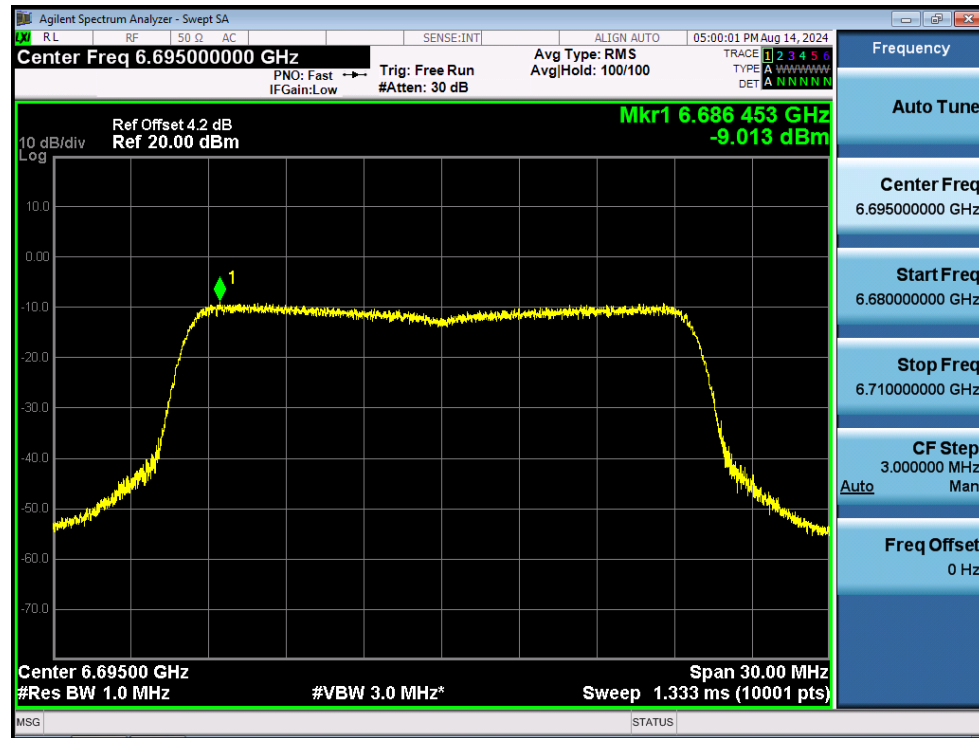


PSD NVNT ax20 6855MHz Ant4

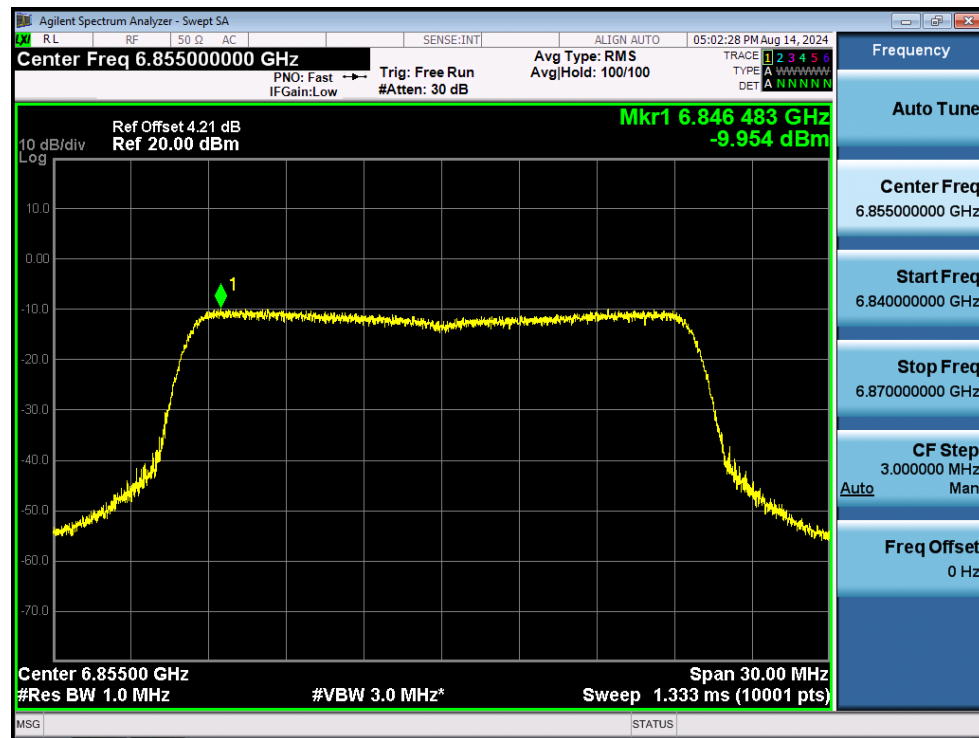


PSD NVNT ax20 6875MHz Ant4

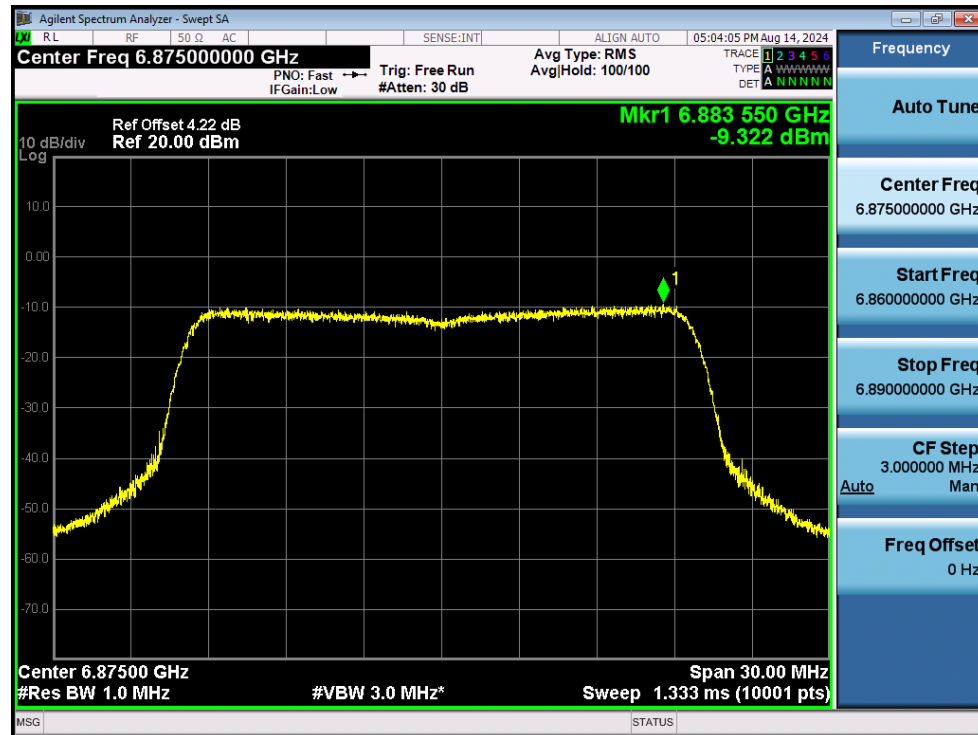


PSD NVNT ax20 6895MHz Ant4

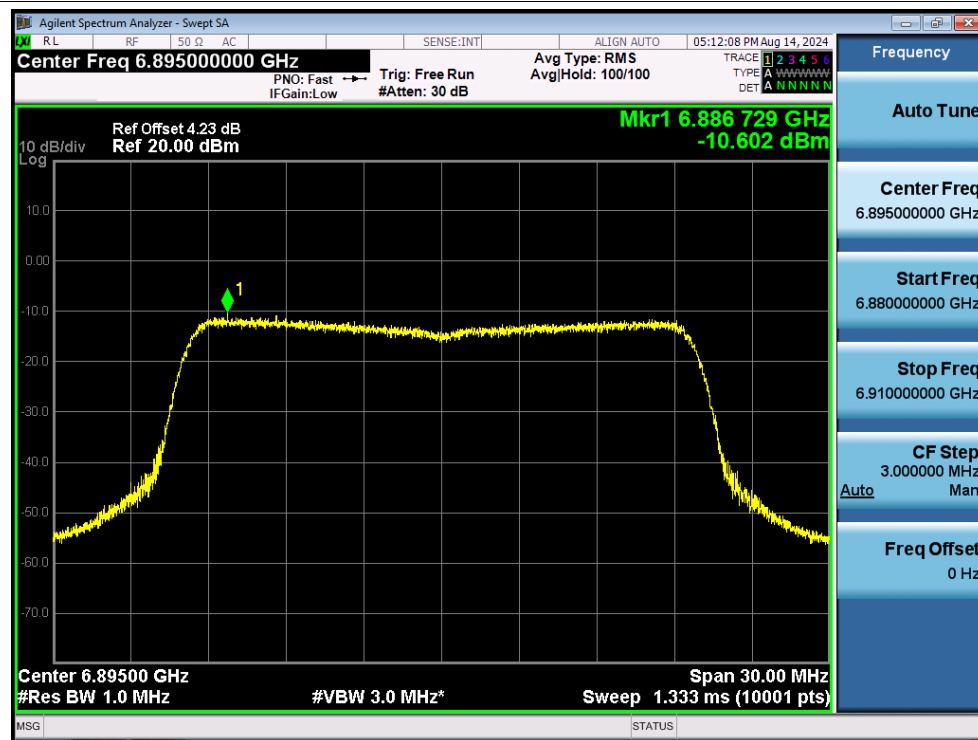


PSD NVNT ax20 6995MHz Ant4

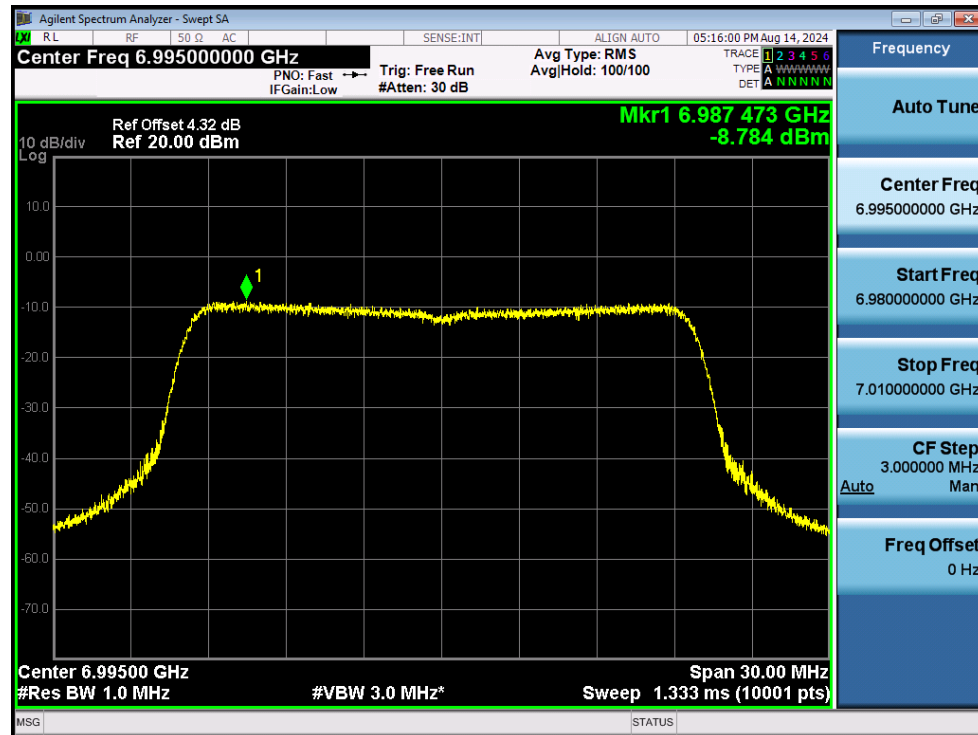


PSD NVNT ax20 7115MHz Ant4

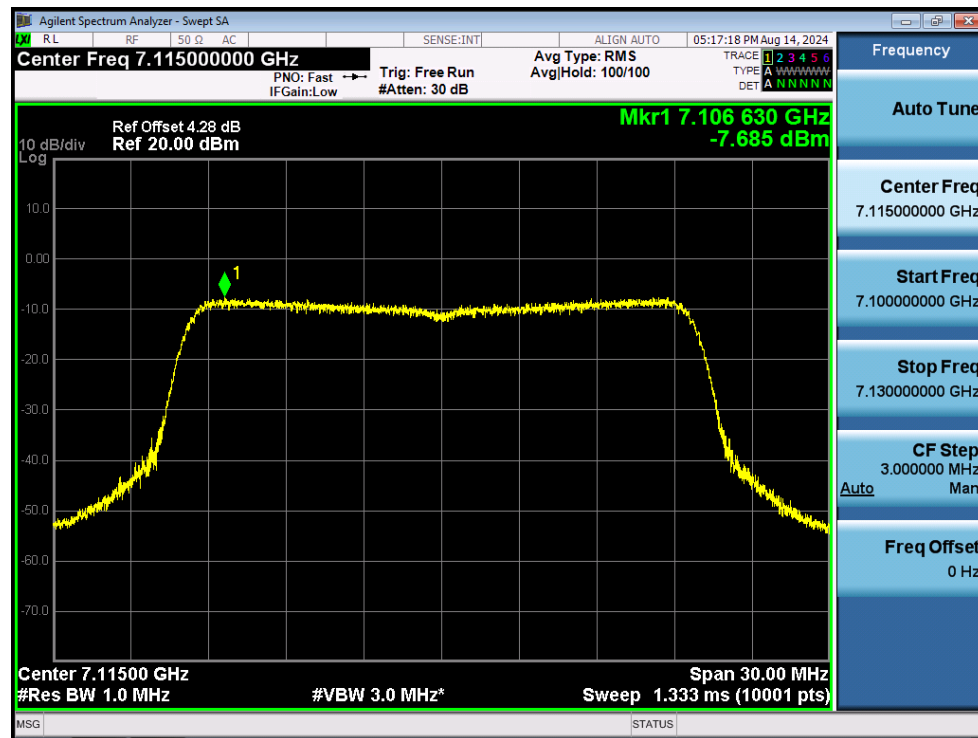


PSD NVNT ax20 5955MHz Ant1

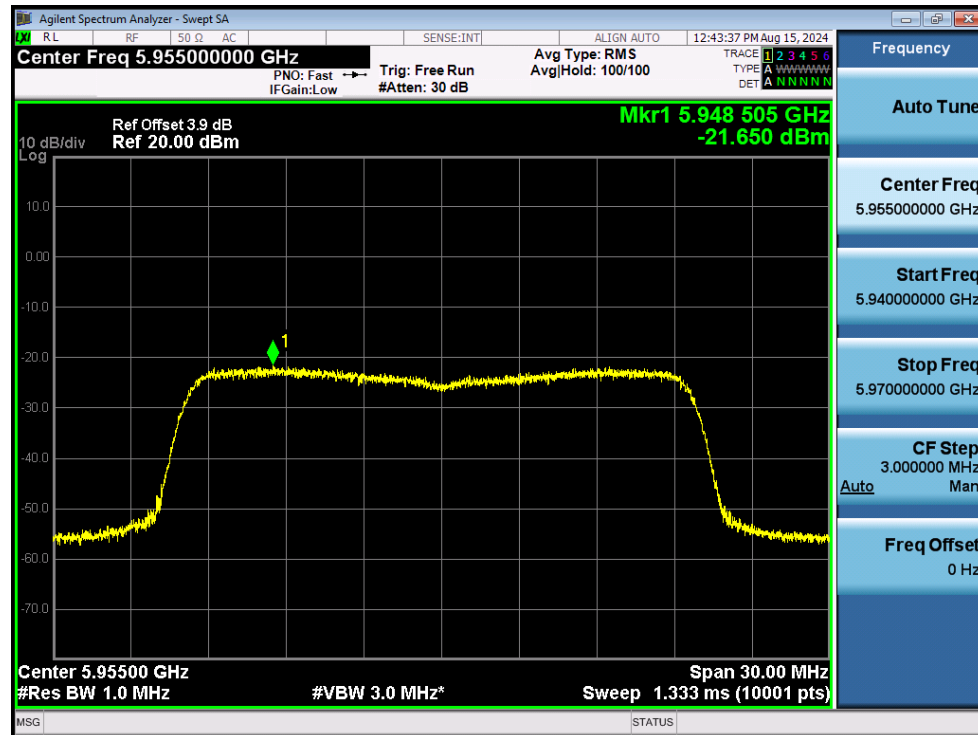


PSD NVNT ax20 5955MHz Ant2

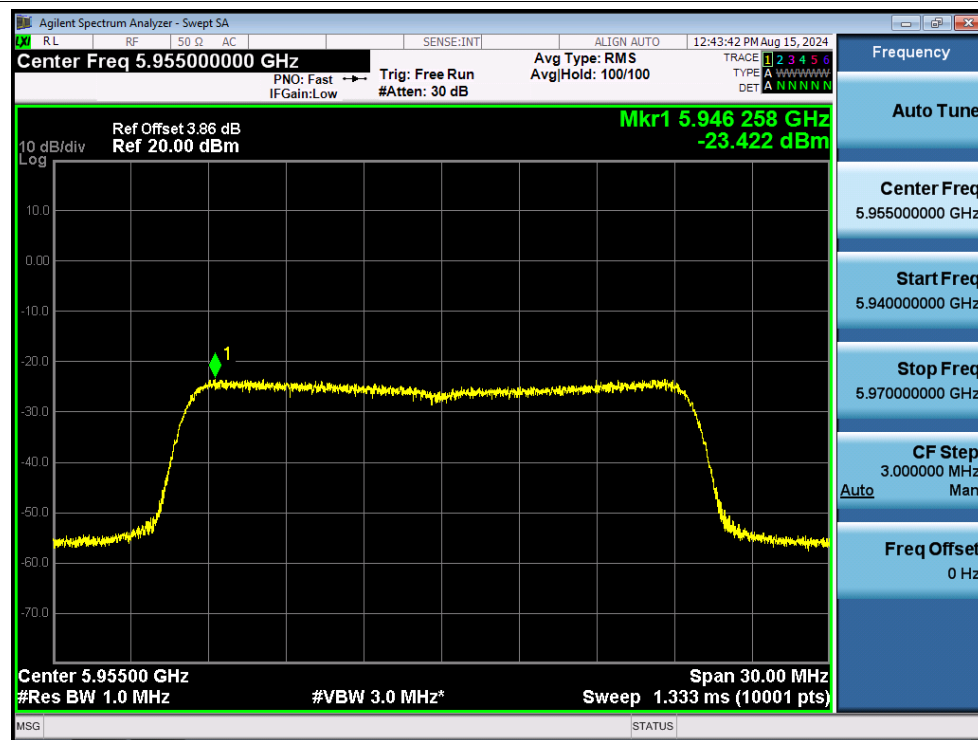


PSD NVNT ax20 5955MHz Ant3

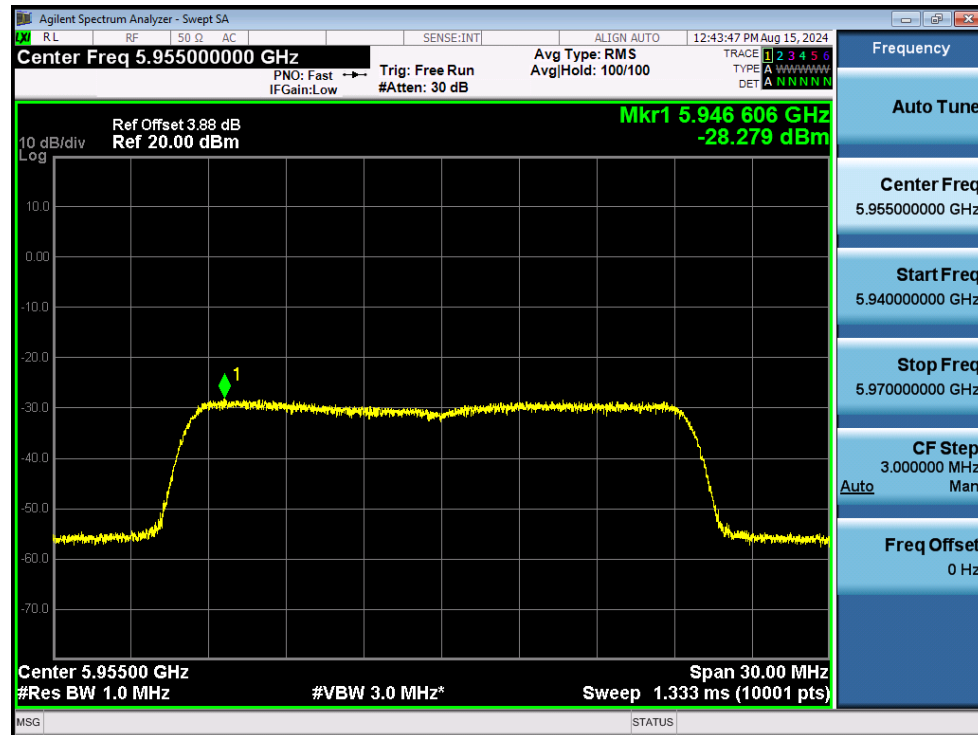


PSD NVNT ax20 5955MHz Ant4

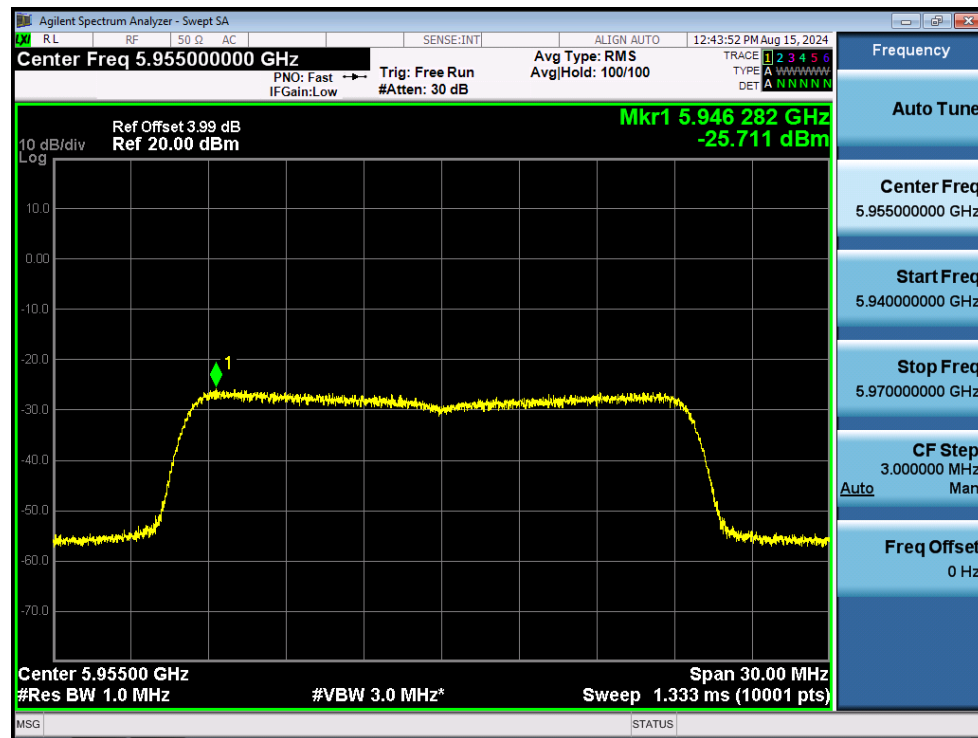


PSD NVNT ax20 6175MHz Ant1

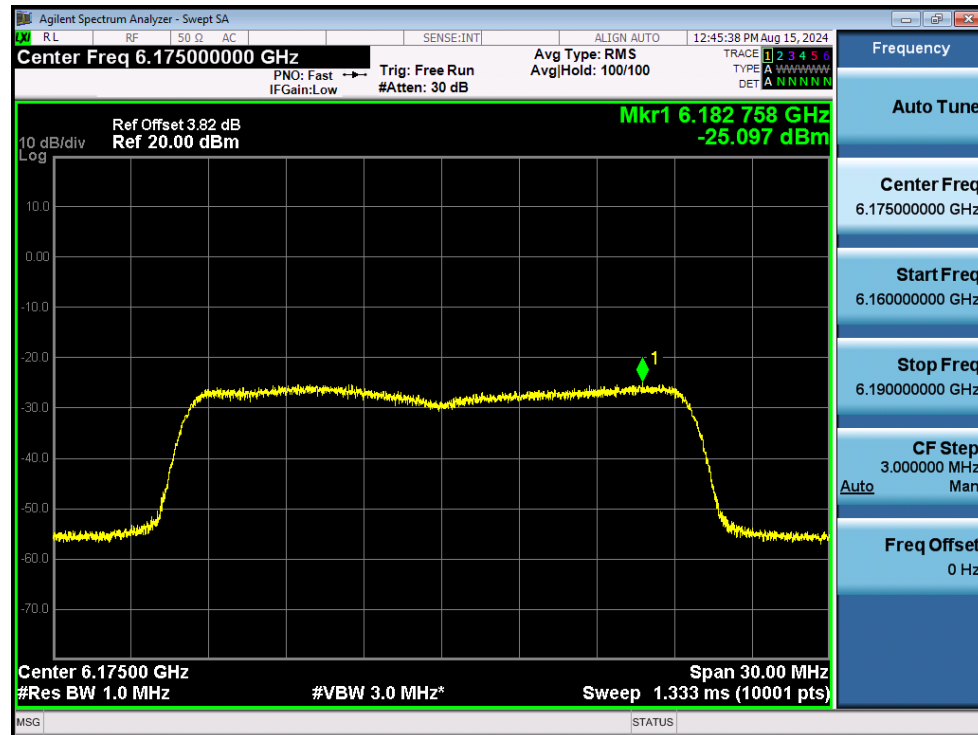


PSD NVNT ax20 6175MHz Ant2

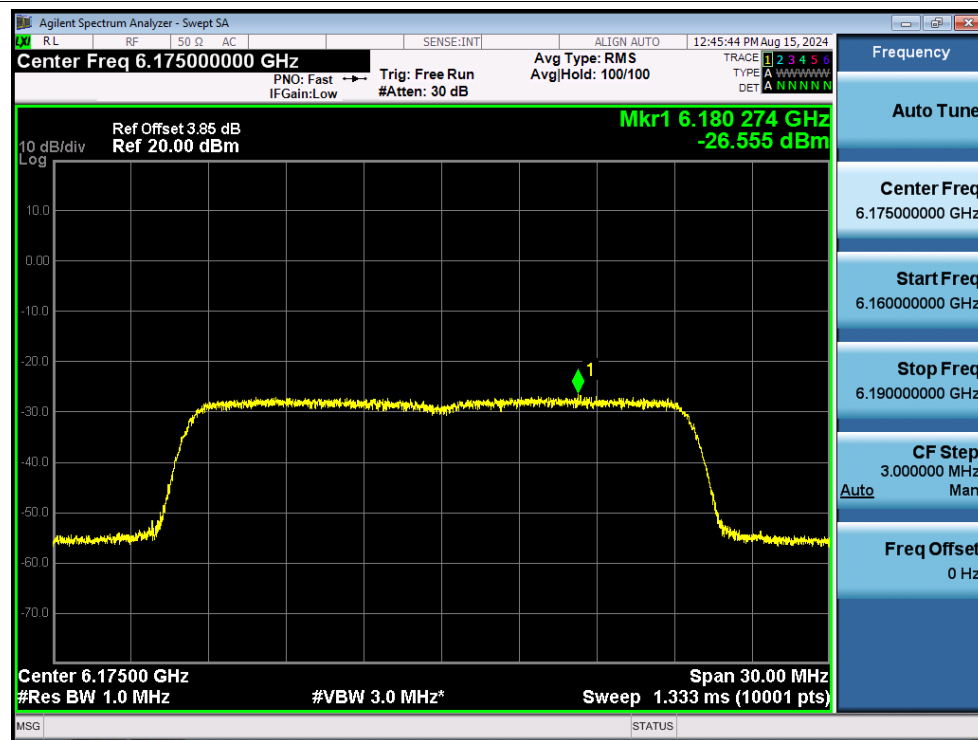


PSD NVNT ax20 6175MHz Ant3

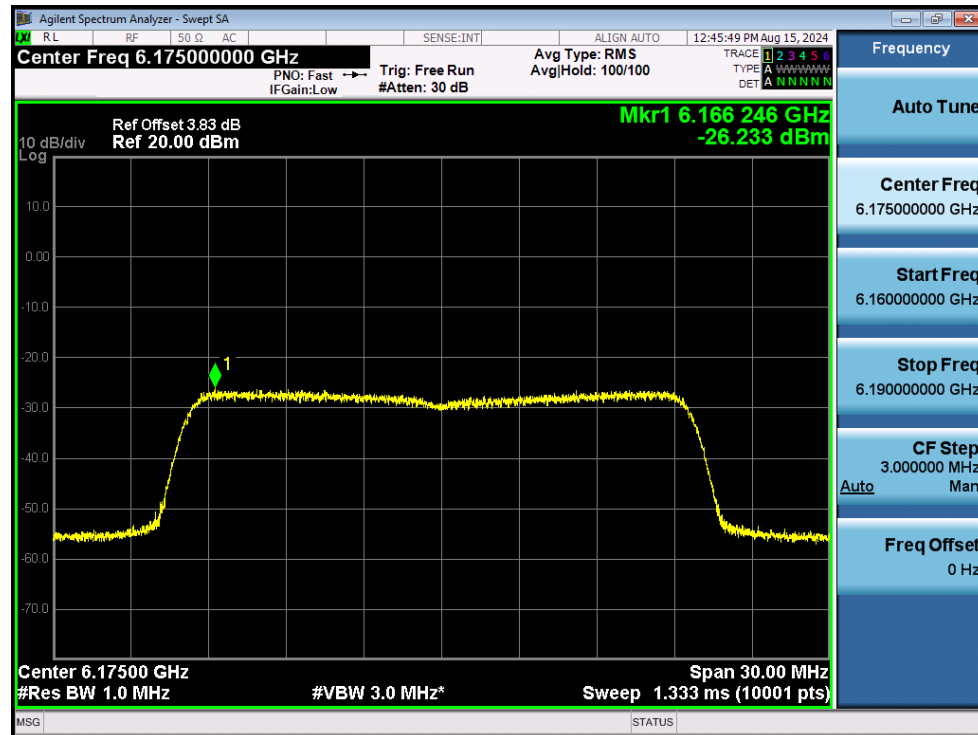


PSD NVNT ax20 6175MHz Ant4

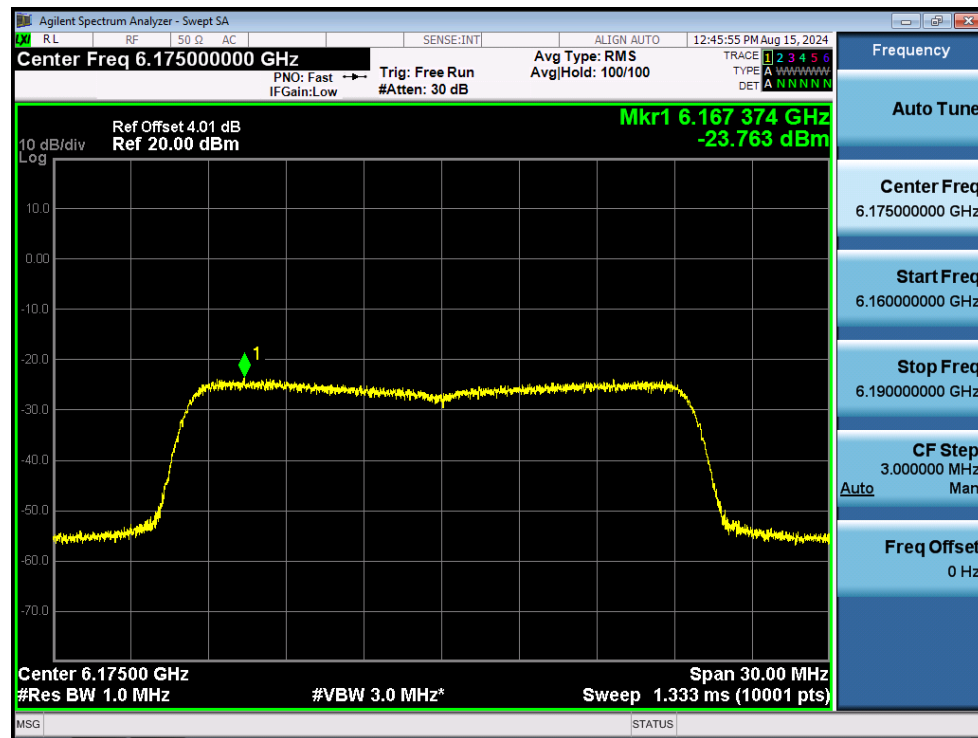


PSD NVNT ax20 6415MHz Ant1

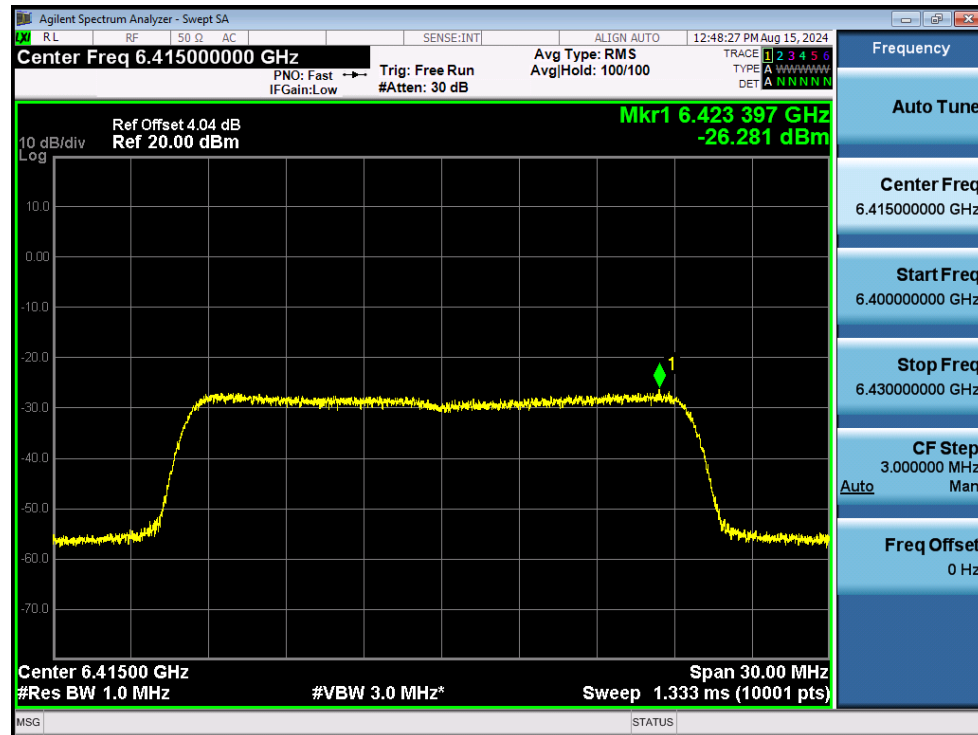


PSD NVNT ax20 6415MHz Ant2

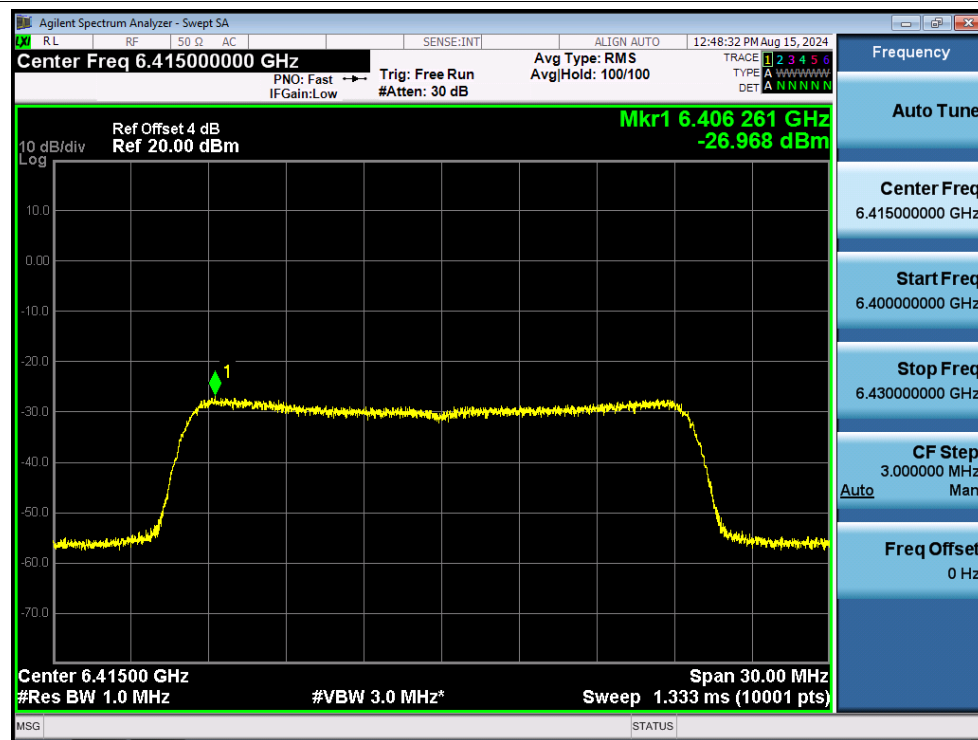


PSD NVNT ax20 6415MHz Ant3

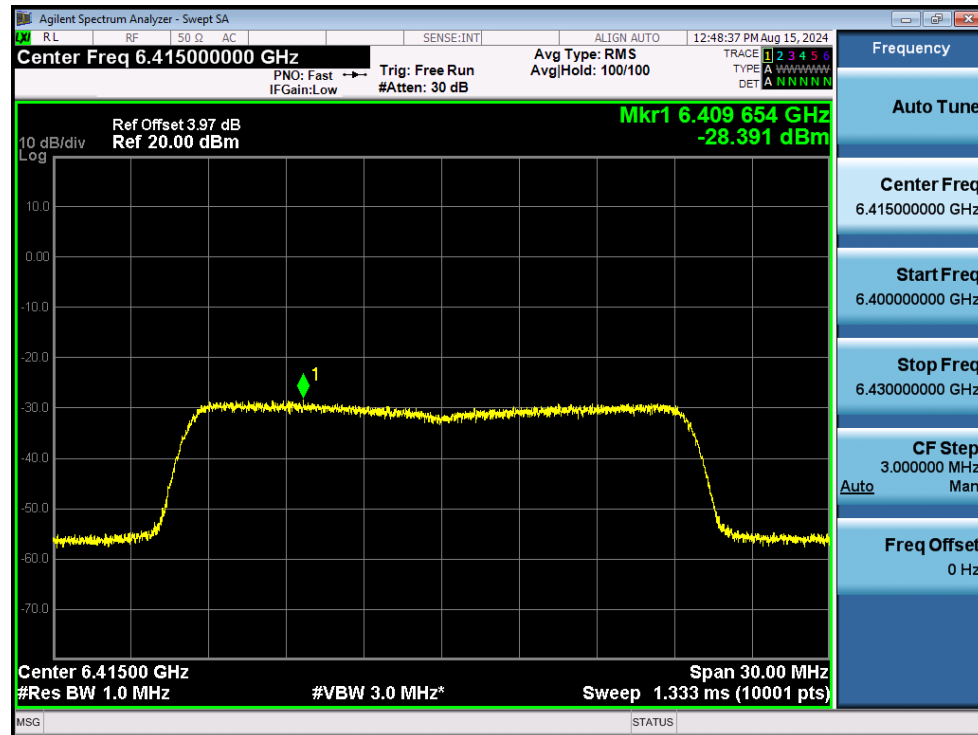


PSD NVNT ax20 6415MHz Ant4

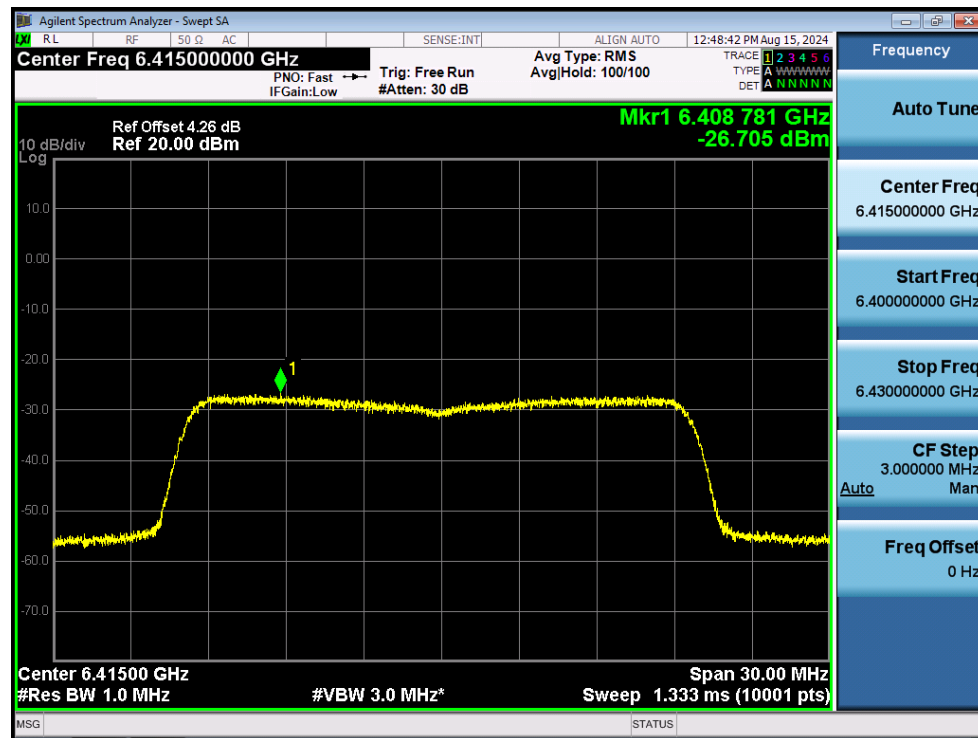


PSD NVNT ax20 6435MHz Ant1

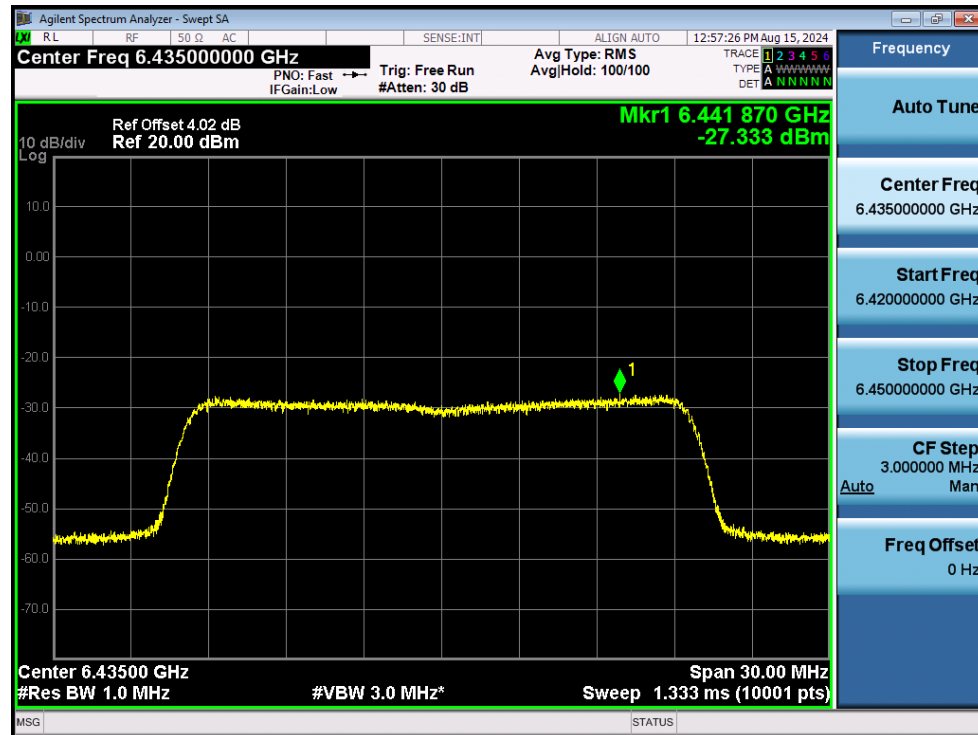


PSD NVNT ax20 6435MHz Ant2

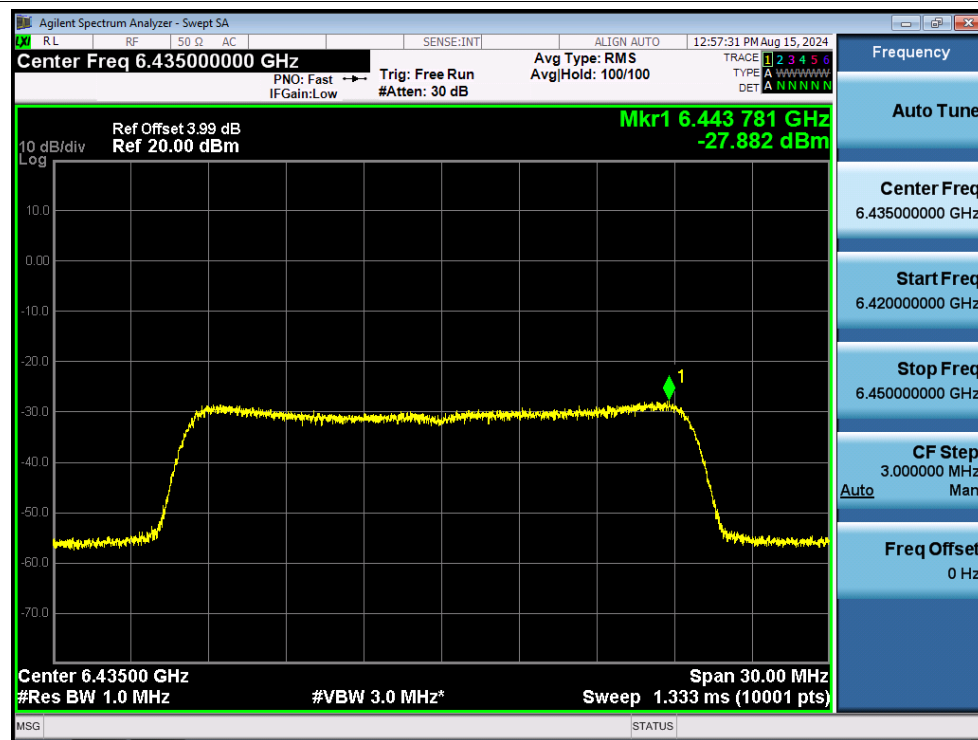


PSD NVNT ax20 6435MHz Ant3

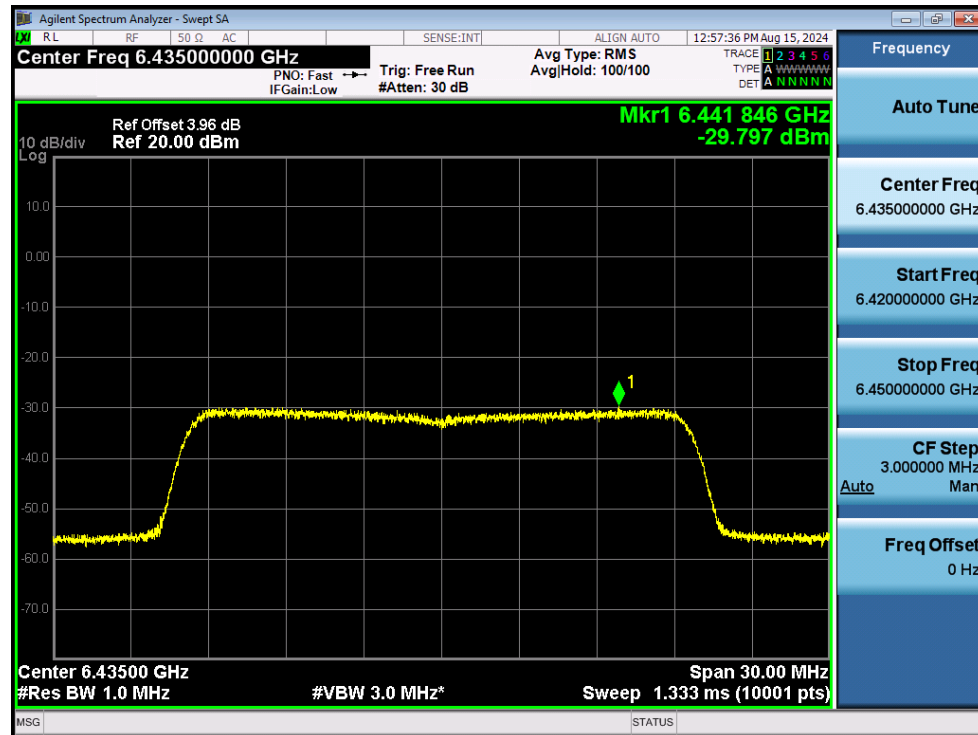


PSD NVNT ax20 6435MHz Ant4

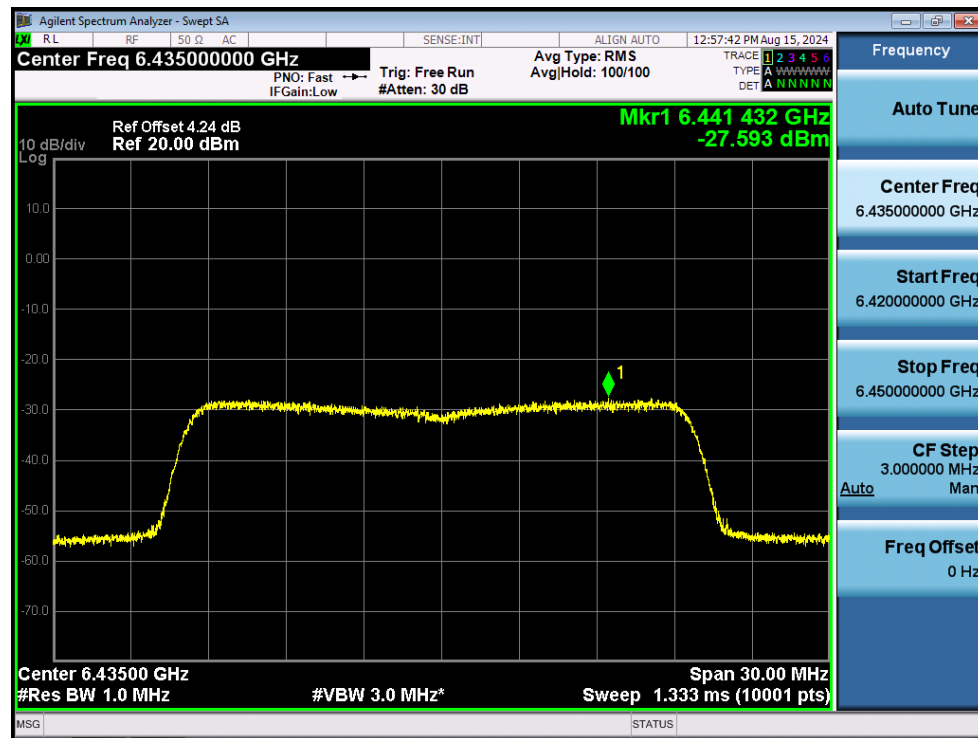


PSD NVNT ax20 6475MHz Ant1

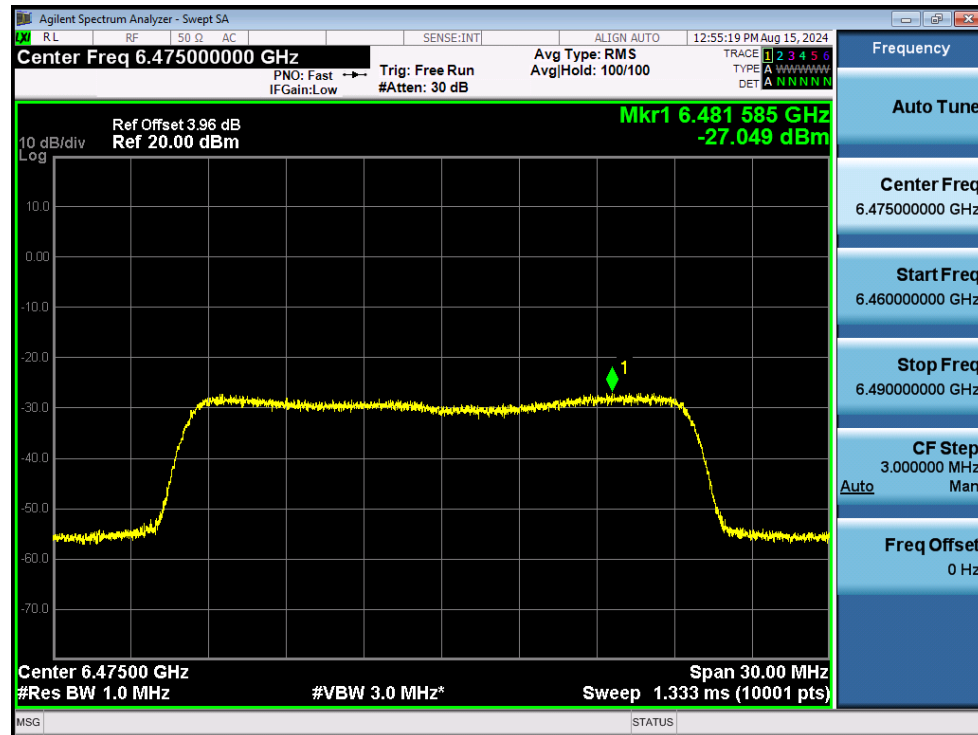

PSD NVNT ax20 6475MHz Ant2

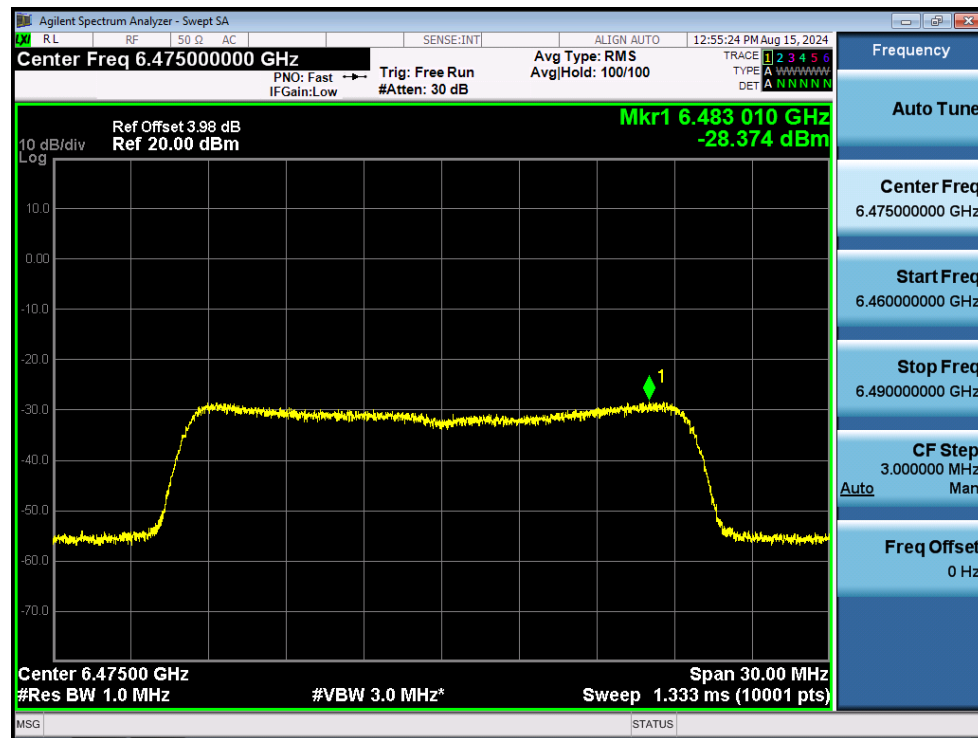


PSD NVNT ax20 6475MHz Ant3

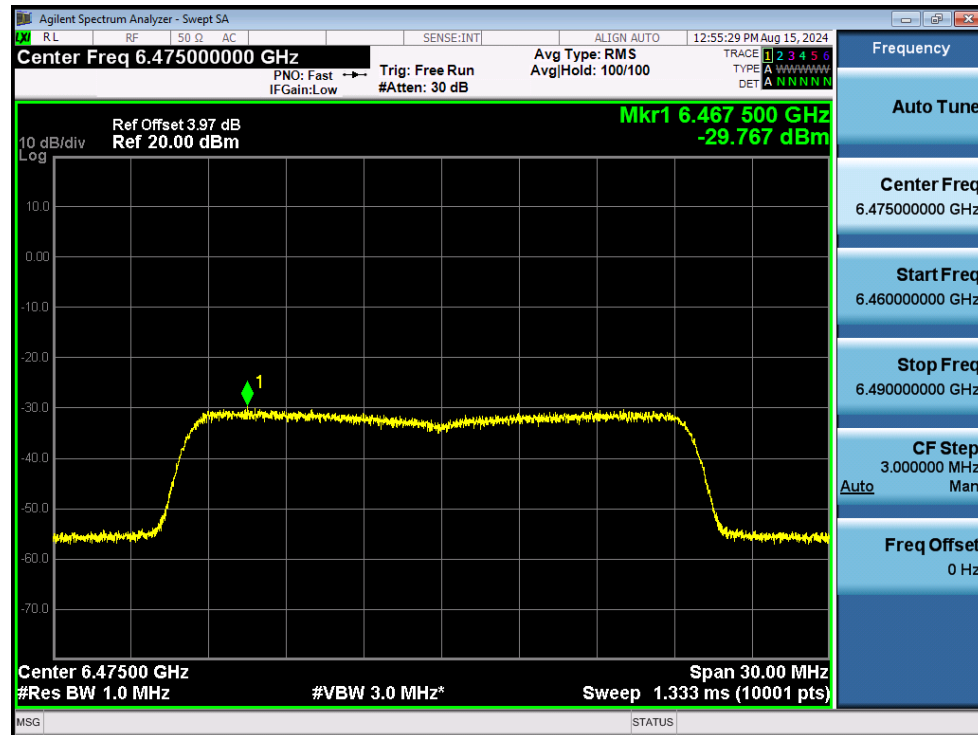


PSD NVNT ax20 6475MHz Ant4




PSD NVNT ax20 6515MHz Ant1

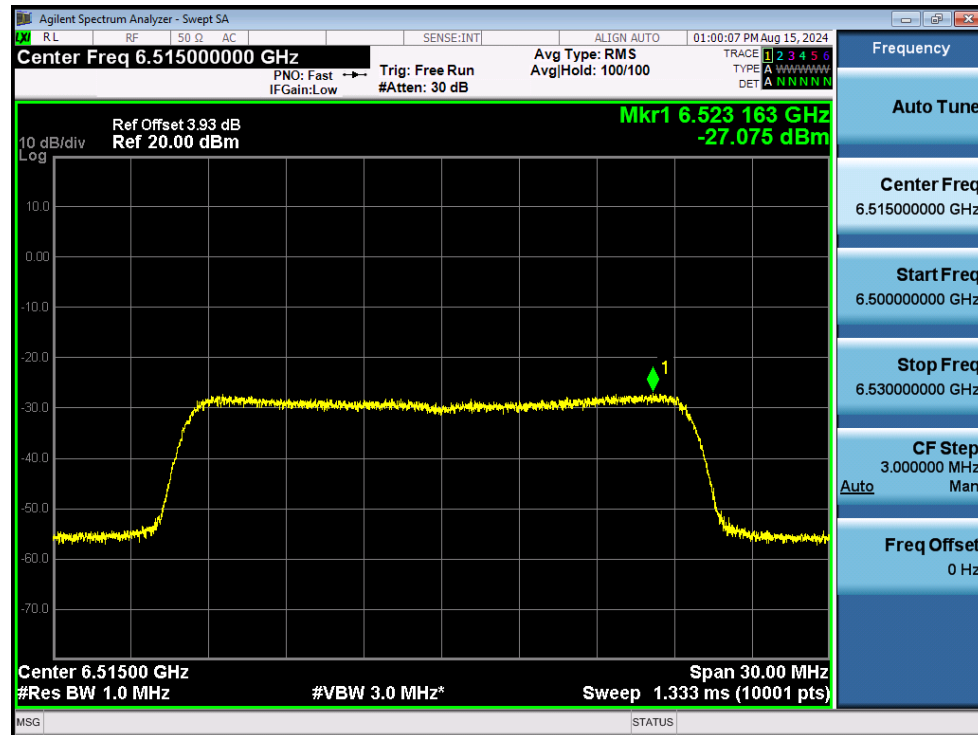


PSD NVNT ax20 6515MHz Ant2

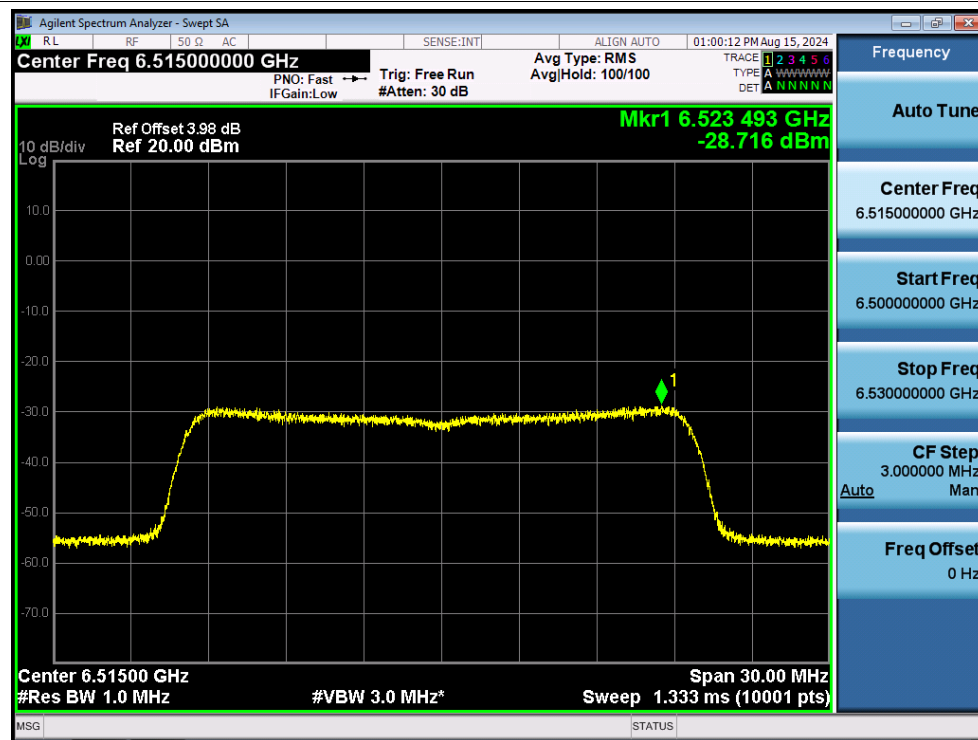


PSD NVNT ax20 6515MHz Ant3

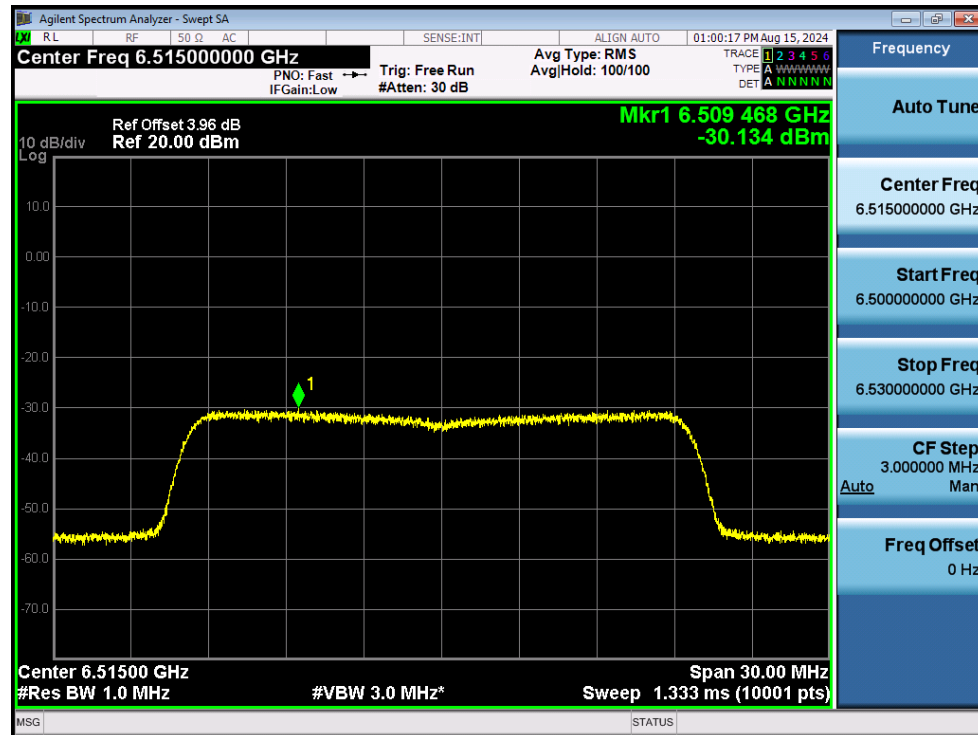


PSD NVNT ax20 6515MHz Ant4

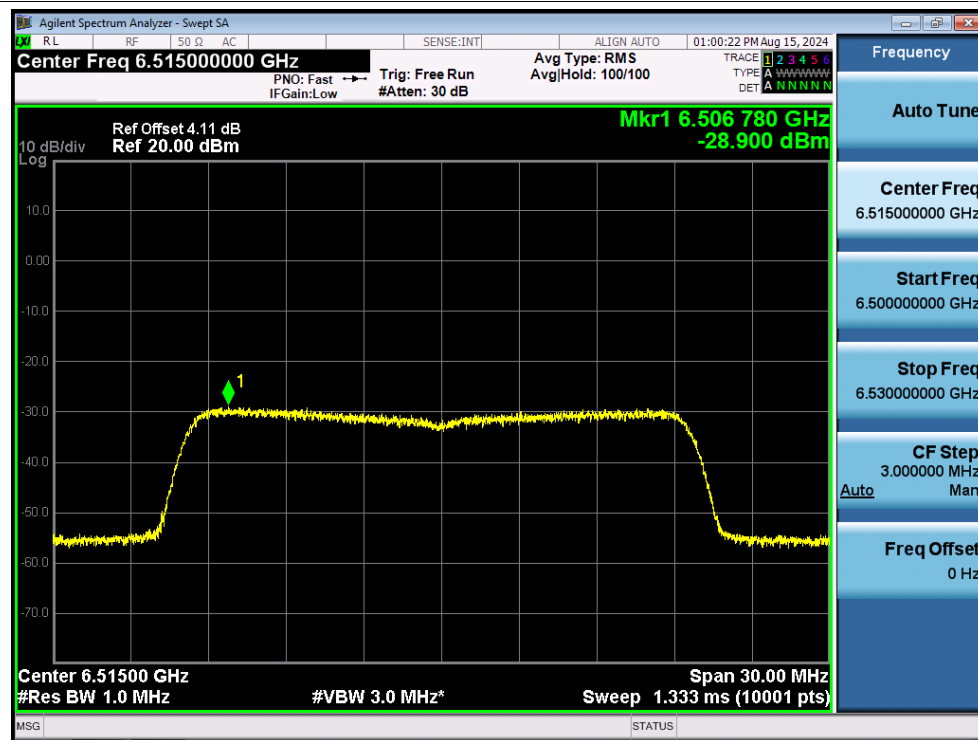


PSD NVNT ax20 6535MHz Ant1

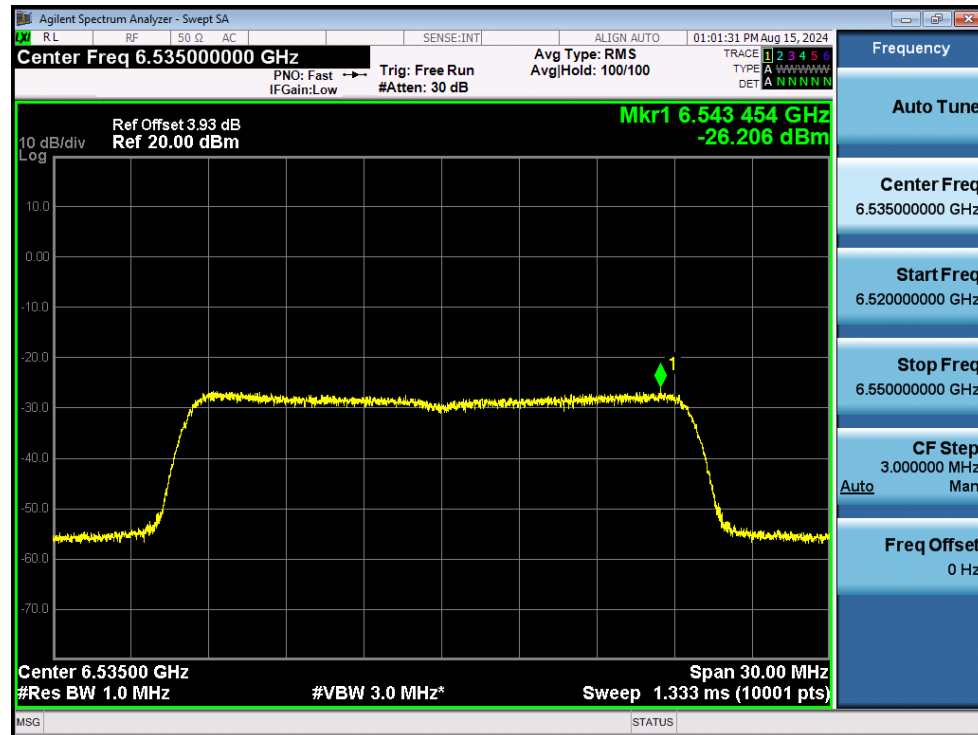


PSD NVNT ax20 6535MHz Ant2

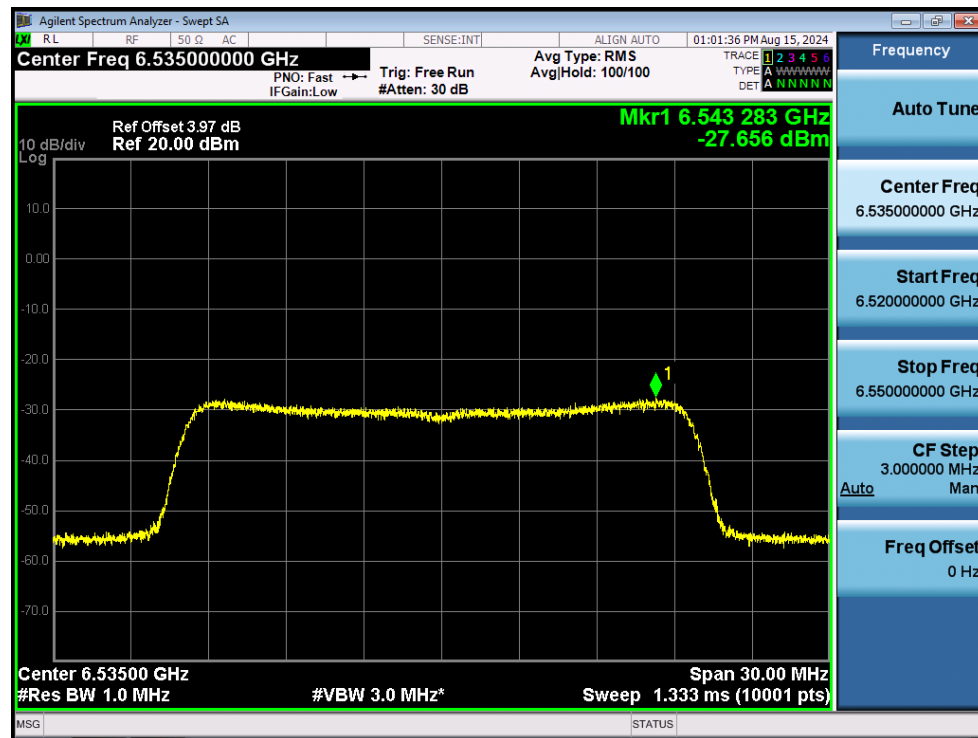


PSD NVNT ax20 6535MHz Ant3

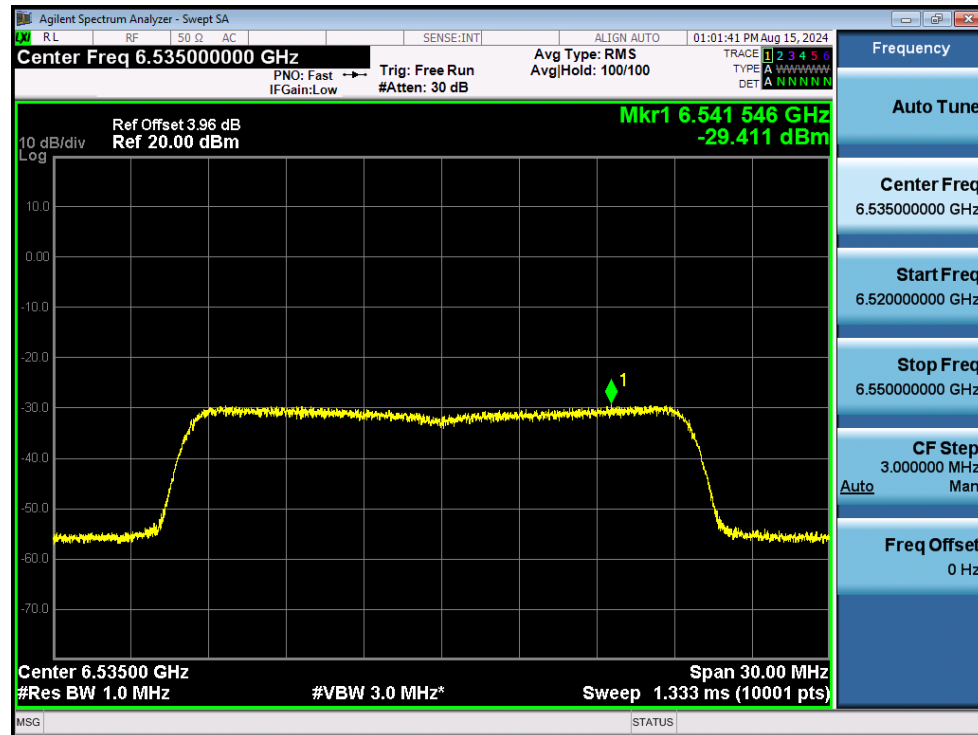

PSD NVNT ax20 6535MHz Ant4

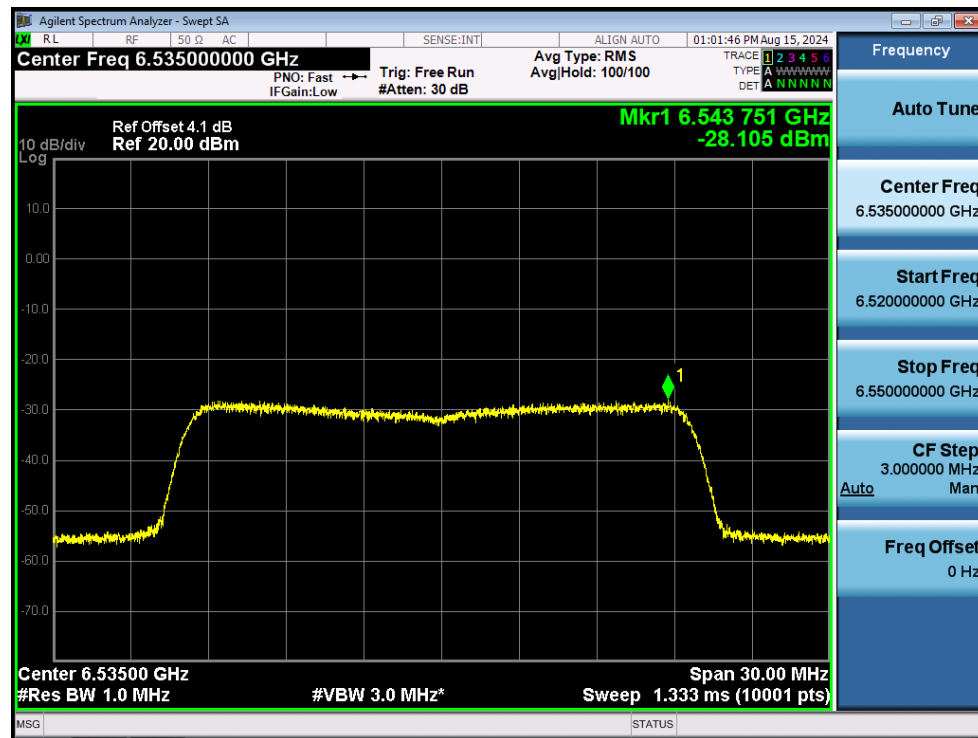


PSD NVNT ax20 6695MHz Ant1

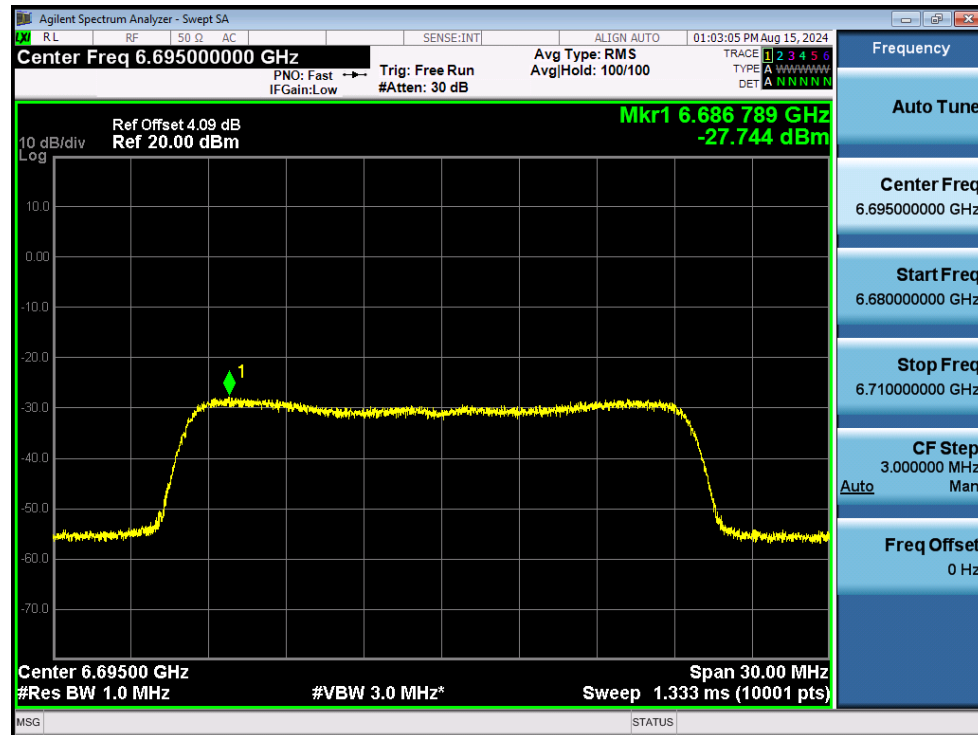

PSD NVNT ax20 6695MHz Ant2




PSD NVNT ax20 6695MHz Ant3

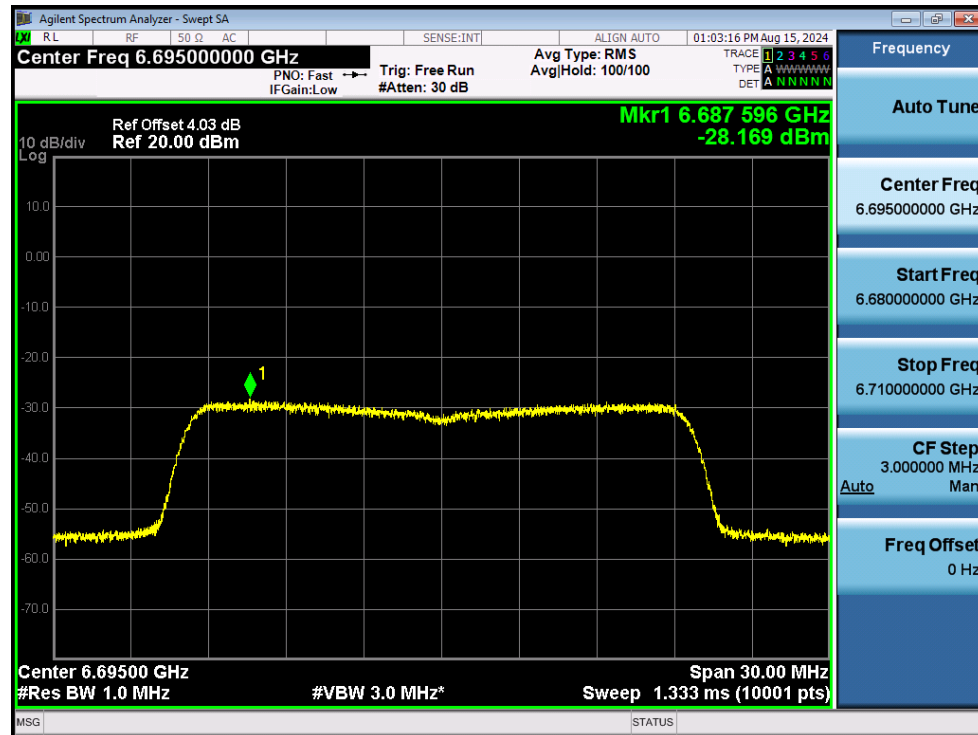

PSD NVNT ax20 6695MHz Ant4



PSD NVNT ax20 6855MHz Ant1

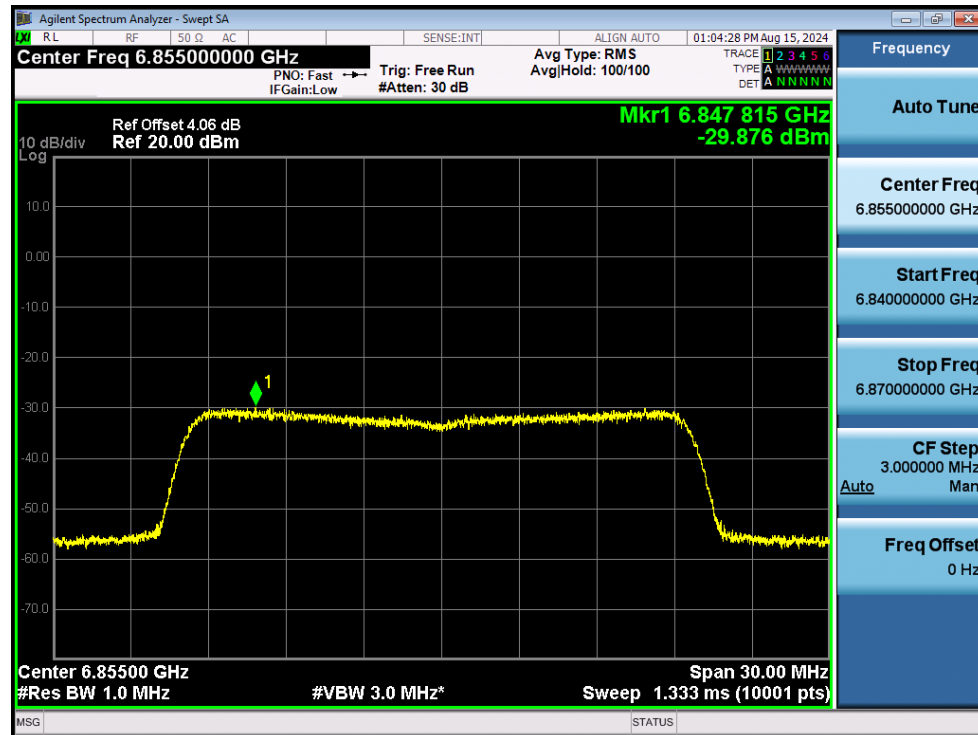

PSD NVNT ax20 6855MHz Ant2

