

Appendix Test Data

Report No:	1816C50010012503	Test Sample NO:	1-2-2
Start Test Date:	2025-06-27	Finish Test Date:	2025-07-2
Test Engineer:	<i>Joker Huang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	24.3°C	Relative Humidity:	56%
Pressure:	101 kPa		

Appendix A: Conducted Output Power for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NBIndex	Conducted Power (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1	0	Low	22.04	PASS
Band2	1.4MHz	QPSK	18607	1	5	Low	22.09	PASS
Band2	1.4MHz	QPSK	18607	6	0	Low	21.15	PASS
Band2	1.4MHz	16QAM	18607	1	0	Low	21.93	PASS
Band2	1.4MHz	16QAM	18607	1	5	Low	21.78	PASS
Band2	1.4MHz	16QAM	18607	6	0	Low	20.88	PASS
Band2	1.4MHz	QPSK	18900	1	0	Low	22.14	PASS
Band2	1.4MHz	QPSK	18900	1	5	Low	22.19	PASS
Band2	1.4MHz	QPSK	18900	6	0	Low	21.04	PASS
Band2	1.4MHz	16QAM	18900	1	0	Low	22.07	PASS
Band2	1.4MHz	16QAM	18900	1	5	Low	21.96	PASS
Band2	1.4MHz	16QAM	18900	6	0	Low	20.73	PASS
Band2	1.4MHz	QPSK	19193	1	0	High	21.96	PASS
Band2	1.4MHz	QPSK	19193	1	5	High	21.90	PASS
Band2	1.4MHz	QPSK	19193	6	0	High	20.84	PASS
Band2	1.4MHz	16QAM	19193	1	0	High	21.55	PASS
Band2	1.4MHz	16QAM	19193	1	5	High	21.44	PASS
Band2	1.4MHz	16QAM	19193	6	0	High	20.84	PASS
Band2	3MHz	QPSK	18615	1	0	Low	21.74	PASS
Band2	3MHz	QPSK	18615	1	5	Low	21.67	PASS
Band2	3MHz	QPSK	18615	6	0	Low	21.11	PASS
Band2	3MHz	16QAM	18615	1	0	Low	21.29	PASS
Band2	3MHz	16QAM	18615	1	5	Low	21.26	PASS
Band2	3MHz	16QAM	18615	6	0	Low	21.10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	18900	1	0	Low	21.79	PASS
Band2	3MHz	QPSK	18900	1	5	Low	21.79	PASS
Band2	3MHz	QPSK	18900	6	0	Low	21.33	PASS
Band2	3MHz	16QAM	18900	1	0	Low	21.38	PASS
Band2	3MHz	16QAM	18900	1	5	Low	21.35	PASS
Band2	3MHz	16QAM	18900	6	0	Low	21.27	PASS
Band2	3MHz	QPSK	19185	1	0	High	21.73	PASS
Band2	3MHz	QPSK	19185	1	5	High	21.68	PASS
Band2	3MHz	QPSK	19185	6	0	High	20.94	PASS
Band2	3MHz	16QAM	19185	1	0	High	21.33	PASS
Band2	3MHz	16QAM	19185	1	5	High	21.17	PASS
Band2	3MHz	16QAM	19185	6	0	High	21.01	PASS
Band2	5MHz	QPSK	18625	1	0	Low	21.84	PASS
Band2	5MHz	QPSK	18625	1	5	Low	21.74	PASS
Band2	5MHz	QPSK	18625	6	0	Low	21.15	PASS
Band2	5MHz	16QAM	18625	1	0	Low	21.42	PASS
Band2	5MHz	16QAM	18625	1	5	Low	21.28	PASS
Band2	5MHz	16QAM	18625	6	0	Low	21.15	PASS
Band2	5MHz	QPSK	18900	1	0	Low	21.92	PASS
Band2	5MHz	QPSK	18900	1	5	Low	21.90	PASS
Band2	5MHz	QPSK	18900	6	0	Low	21.22	PASS
Band2	5MHz	16QAM	18900	1	0	Low	21.63	PASS
Band2	5MHz	16QAM	18900	1	5	Low	21.33	PASS
Band2	5MHz	16QAM	18900	6	0	Low	21.22	PASS
Band2	5MHz	QPSK	19175	1	0	High	21.75	PASS
Band2	5MHz	QPSK	19175	1	5	High	21.48	PASS
Band2	5MHz	QPSK	19175	6	0	High	20.89	PASS
Band2	5MHz	16QAM	19175	1	0	High	21.41	PASS
Band2	5MHz	16QAM	19175	1	5	High	21.32	PASS
Band2	5MHz	16QAM	19175	6	0	High	20.88	PASS
Band2	10MHz	QPSK	18650	1	0	Low	21.76	PASS
Band2	10MHz	QPSK	18650	1	5	Low	21.67	PASS
Band2	10MHz	QPSK	18650	6	0	Low	21.47	PASS
Band2	10MHz	16QAM	18650	1	0	Low	21.36	PASS
Band2	10MHz	16QAM	18650	1	5	Low	21.27	PASS
Band2	10MHz	16QAM	18650	6	0	Low	21.57	PASS
Band2	10MHz	QPSK	18900	1	0	Low	21.95	PASS
Band2	10MHz	QPSK	18900	1	5	Low	21.81	PASS
Band2	10MHz	QPSK	18900	6	0	Low	21.61	PASS
Band2	10MHz	16QAM	18900	1	0	Low	21.61	PASS
Band2	10MHz	16QAM	18900	1	5	Low	21.34	PASS
Band2	10MHz	16QAM	18900	6	0	Low	21.71	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	10MHz	QPSK	19150	1	0	High	21.76	PASS
Band2	10MHz	QPSK	19150	1	5	High	21.49	PASS
Band2	10MHz	QPSK	19150	6	0	High	21.33	PASS
Band2	10MHz	16QAM	19150	1	0	High	21.42	PASS
Band2	10MHz	16QAM	19150	1	5	High	21.29	PASS
Band2	10MHz	16QAM	19150	6	0	High	21.49	PASS
Band2	15MHz	QPSK	18675	1	0	Low	21.87	PASS
Band2	15MHz	QPSK	18675	1	5	Low	21.78	PASS
Band2	15MHz	QPSK	18675	6	0	Low	21.53	PASS
Band2	15MHz	16QAM	18675	1	0	Low	21.46	PASS
Band2	15MHz	16QAM	18675	1	5	Low	21.26	PASS
Band2	15MHz	16QAM	18675	6	0	Low	21.63	PASS
Band2	15MHz	QPSK	18900	1	0	Low	21.96	PASS
Band2	15MHz	QPSK	18900	1	5	Low	21.85	PASS
Band2	15MHz	QPSK	18900	6	0	Low	21.58	PASS
Band2	15MHz	16QAM	18900	1	0	Low	21.50	PASS
Band2	15MHz	16QAM	18900	1	5	Low	21.23	PASS
Band2	15MHz	16QAM	18900	6	0	Low	21.69	PASS
Band2	15MHz	QPSK	19125	1	0	High	21.76	PASS
Band2	15MHz	QPSK	19125	1	5	High	21.71	PASS
Band2	15MHz	QPSK	19125	6	0	High	21.40	PASS
Band2	15MHz	16QAM	19125	1	0	High	21.47	PASS
Band2	15MHz	16QAM	19125	1	5	High	21.23	PASS
Band2	15MHz	16QAM	19125	6	0	High	21.56	PASS
Band2	20MHz	QPSK	18700	1	0	Low	21.91	PASS
Band2	20MHz	QPSK	18700	1	5	Low	21.83	PASS
Band2	20MHz	QPSK	18700	6	0	Low	21.64	PASS
Band2	20MHz	16QAM	18700	1	0	Low	21.55	PASS
Band2	20MHz	16QAM	18700	1	5	Low	21.31	PASS
Band2	20MHz	16QAM	18700	6	0	Low	21.69	PASS
Band2	20MHz	QPSK	18900	1	0	Low	22.01	PASS
Band2	20MHz	QPSK	18900	1	5	Low	22.00	PASS
Band2	20MHz	QPSK	18900	6	0	Low	21.75	PASS
Band2	20MHz	16QAM	18900	1	0	Low	21.59	PASS
Band2	20MHz	16QAM	18900	1	5	Low	21.43	PASS
Band2	20MHz	16QAM	18900	6	0	Low	21.75	PASS
Band2	20MHz	QPSK	19100	1	0	High	22.07	PASS
Band2	20MHz	QPSK	19100	1	5	High	21.72	PASS
Band2	20MHz	QPSK	19100	6	0	High	21.72	PASS
Band2	20MHz	16QAM	19100	1	0	High	21.68	PASS
Band2	20MHz	16QAM	19100	1	5	High	21.47	PASS
Band2	20MHz	16QAM	19100	6	0	High	21.72	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Peak-to-Average Ratio(CCDF) for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NBIndex	Result(dB)	Limit(dB)	Verdict
Band2	1.4MHz	QPSK	18607	1	0	Low	1.57	<=13	PASS
Band2	1.4MHz	QPSK	18607	6	0	Low	3.86	<=13	PASS
Band2	1.4MHz	16QAM	18607	1	0	Low	1.97	<=13	PASS
Band2	1.4MHz	16QAM	18607	6	0	Low	3.90	<=13	PASS
Band2	1.4MHz	QPSK	18900	1	0	Low	1.51	<=13	PASS
Band2	1.4MHz	QPSK	18900	6	0	Low	3.34	<=13	PASS
Band2	1.4MHz	16QAM	18900	1	0	Low	1.92	<=13	PASS
Band2	1.4MHz	16QAM	18900	6	0	Low	3.38	<=13	PASS
Band2	1.4MHz	QPSK	19193	1	5	High	2.12	<=13	PASS
Band2	1.4MHz	QPSK	19193	6	0	High	4.16	<=13	PASS
Band2	1.4MHz	16QAM	19193	1	5	High	2.44	<=13	PASS
Band2	1.4MHz	16QAM	19193	6	0	High	4.17	<=13	PASS
Band2	3MHz	QPSK	18615	1	0	Low	1.61	<=13	PASS
Band2	3MHz	QPSK	18615	6	0	Low	2.64	<=13	PASS
Band2	3MHz	16QAM	18615	1	0	Low	2.08	<=13	PASS
Band2	3MHz	16QAM	18615	6	0	Low	2.68	<=13	PASS
Band2	3MHz	QPSK	18900	1	0	Low	1.59	<=13	PASS
Band2	3MHz	QPSK	18900	6	0	Low	2.53	<=13	PASS
Band2	3MHz	16QAM	18900	1	0	Low	2.02	<=13	PASS
Band2	3MHz	16QAM	18900	6	0	Low	2.53	<=13	PASS
Band2	3MHz	QPSK	19185	1	5	High	1.90	<=13	PASS
Band2	3MHz	QPSK	19185	6	0	High	2.78	<=13	PASS
Band2	3MHz	16QAM	19185	1	5	High	2.39	<=13	PASS
Band2	3MHz	16QAM	19185	6	0	High	2.78	<=13	PASS
Band2	5MHz	QPSK	18625	1	0	Low	2.62	<=13	PASS
Band2	5MHz	QPSK	18625	6	0	Low	3.70	<=13	PASS
Band2	5MHz	16QAM	18625	1	0	Low	2.34	<=13	PASS
Band2	5MHz	16QAM	18625	6	0	Low	3.71	<=13	PASS
Band2	5MHz	QPSK	18900	1	0	Low	2.49	<=13	PASS
Band2	5MHz	QPSK	18900	6	0	Low	3.56	<=13	PASS
Band2	5MHz	16QAM	18900	1	0	Low	2.26	<=13	PASS
Band2	5MHz	16QAM	18900	6	0	Low	3.58	<=13	PASS
Band2	5MHz	QPSK	19175	1	5	High	2.78	<=13	PASS
Band2	5MHz	QPSK	19175	6	0	High	3.61	<=13	PASS
Band2	5MHz	16QAM	19175	1	5	High	2.86	<=13	PASS
Band2	5MHz	16QAM	19175	6	0	High	3.57	<=13	PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band2	10MHz	QPSK	18650	1	0	Low	1.65	<=13	PASS
Band2	10MHz	QPSK	18650	6	0	Low	2.09	<=13	PASS
Band2	10MHz	16QAM	18650	1	0	Low	2.16	<=13	PASS
Band2	10MHz	16QAM	18650	6	0	Low	2.08	<=13	PASS
Band2	10MHz	QPSK	18900	1	0	Low	1.54	<=13	PASS
Band2	10MHz	QPSK	18900	6	0	Low	2.00	<=13	PASS
Band2	10MHz	16QAM	18900	1	0	Low	2.12	<=13	PASS
Band2	10MHz	16QAM	18900	6	0	Low	1.96	<=13	PASS
Band2	10MHz	QPSK	19150	1	5	High	2.09	<=13	PASS
Band2	10MHz	QPSK	19150	6	0	High	2.38	<=13	PASS
Band2	10MHz	16QAM	19150	1	5	High	2.67	<=13	PASS
Band2	10MHz	16QAM	19150	6	0	High	2.39	<=13	PASS
Band2	15MHz	QPSK	18675	1	0	Low	1.55	<=13	PASS
Band2	15MHz	QPSK	18675	6	0	Low	2.00	<=13	PASS
Band2	15MHz	16QAM	18675	1	0	Low	2.26	<=13	PASS
Band2	15MHz	16QAM	18675	6	0	Low	1.98	<=13	PASS
Band2	15MHz	QPSK	18900	1	0	Low	1.56	<=13	PASS
Band2	15MHz	QPSK	18900	6	0	Low	1.94	<=13	PASS
Band2	15MHz	16QAM	18900	1	0	Low	2.20	<=13	PASS
Band2	15MHz	16QAM	18900	6	0	Low	1.95	<=13	PASS
Band2	15MHz	QPSK	19125	1	5	High	2.05	<=13	PASS
Band2	15MHz	QPSK	19125	6	0	High	2.29	<=13	PASS
Band2	15MHz	16QAM	19125	1	5	High	2.58	<=13	PASS
Band2	15MHz	16QAM	19125	6	0	High	2.30	<=13	PASS
Band2	20MHz	QPSK	18700	1	0	Low	1.56	<=13	PASS
Band2	20MHz	QPSK	18700	6	0	Low	1.90	<=13	PASS
Band2	20MHz	16QAM	18700	1	0	Low	2.10	<=13	PASS
Band2	20MHz	16QAM	18700	6	0	Low	1.90	<=13	PASS
Band2	20MHz	QPSK	18900	1	0	Low	1.55	<=13	PASS
Band2	20MHz	QPSK	18900	6	0	Low	1.84	<=13	PASS
Band2	20MHz	16QAM	18900	1	0	Low	2.09	<=13	PASS
Band2	20MHz	16QAM	18900	6	0	Low	1.83	<=13	PASS
Band2	20MHz	QPSK	19100	1	5	High	1.97	<=13	PASS
Band2	20MHz	QPSK	19100	6	0	High	2.17	<=13	PASS
Band2	20MHz	16QAM	19100	1	5	High	2.49	<=13	PASS
Band2	20MHz	16QAM	19100	6	0	High	2.18	<=13	PASS


Test Graphs

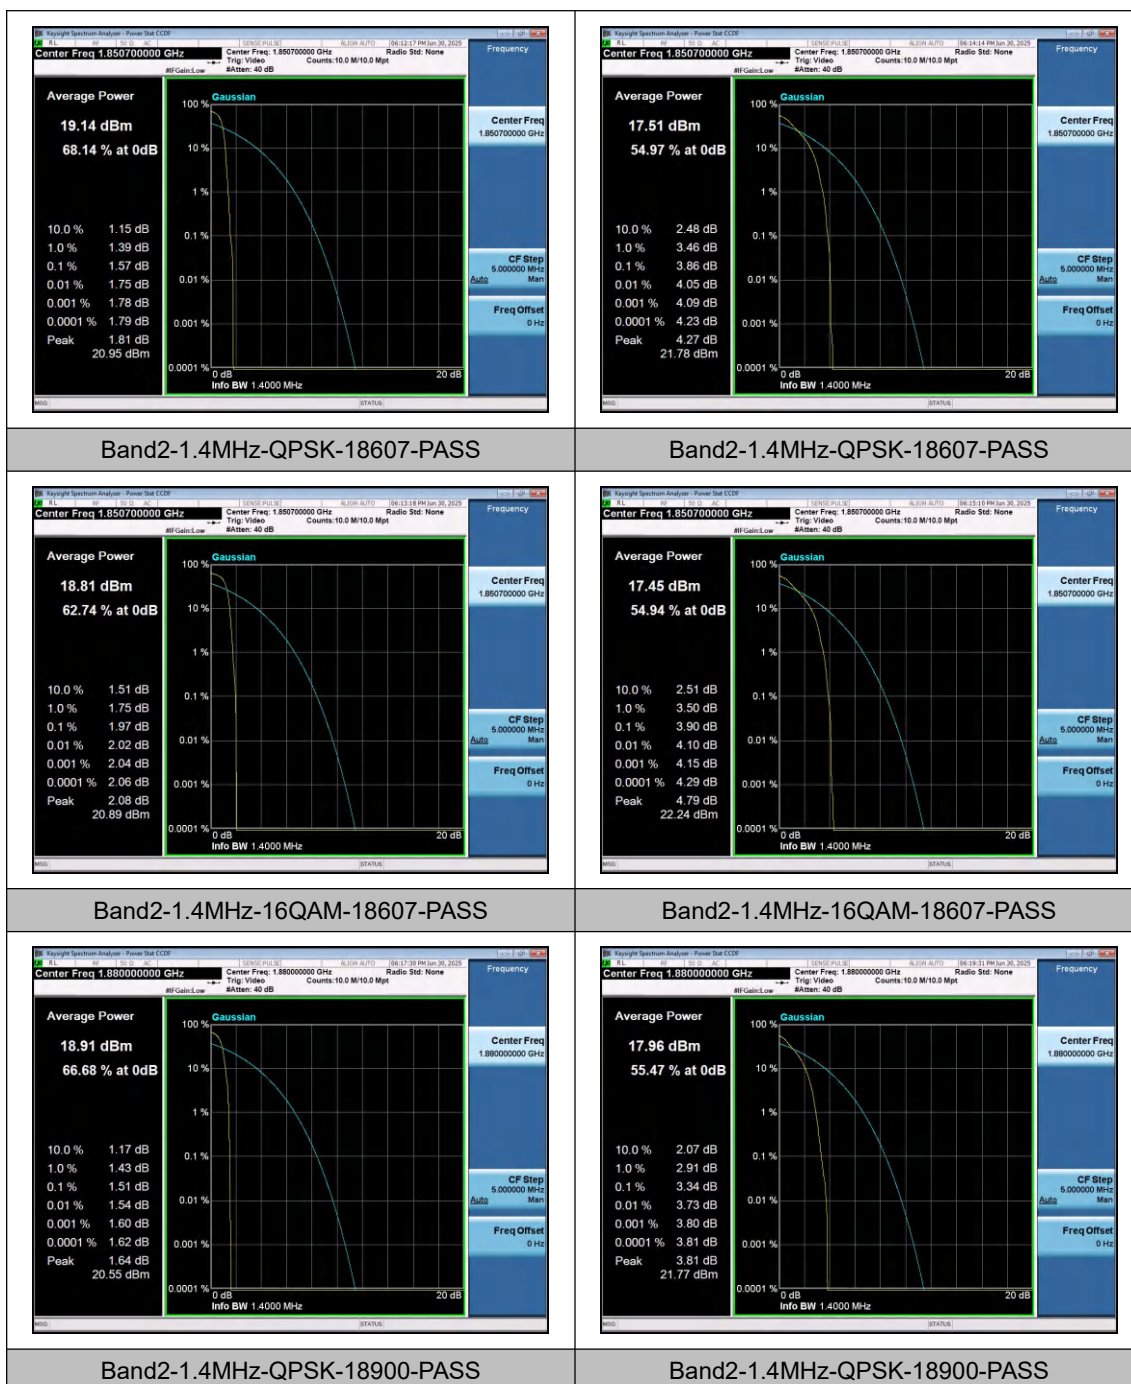





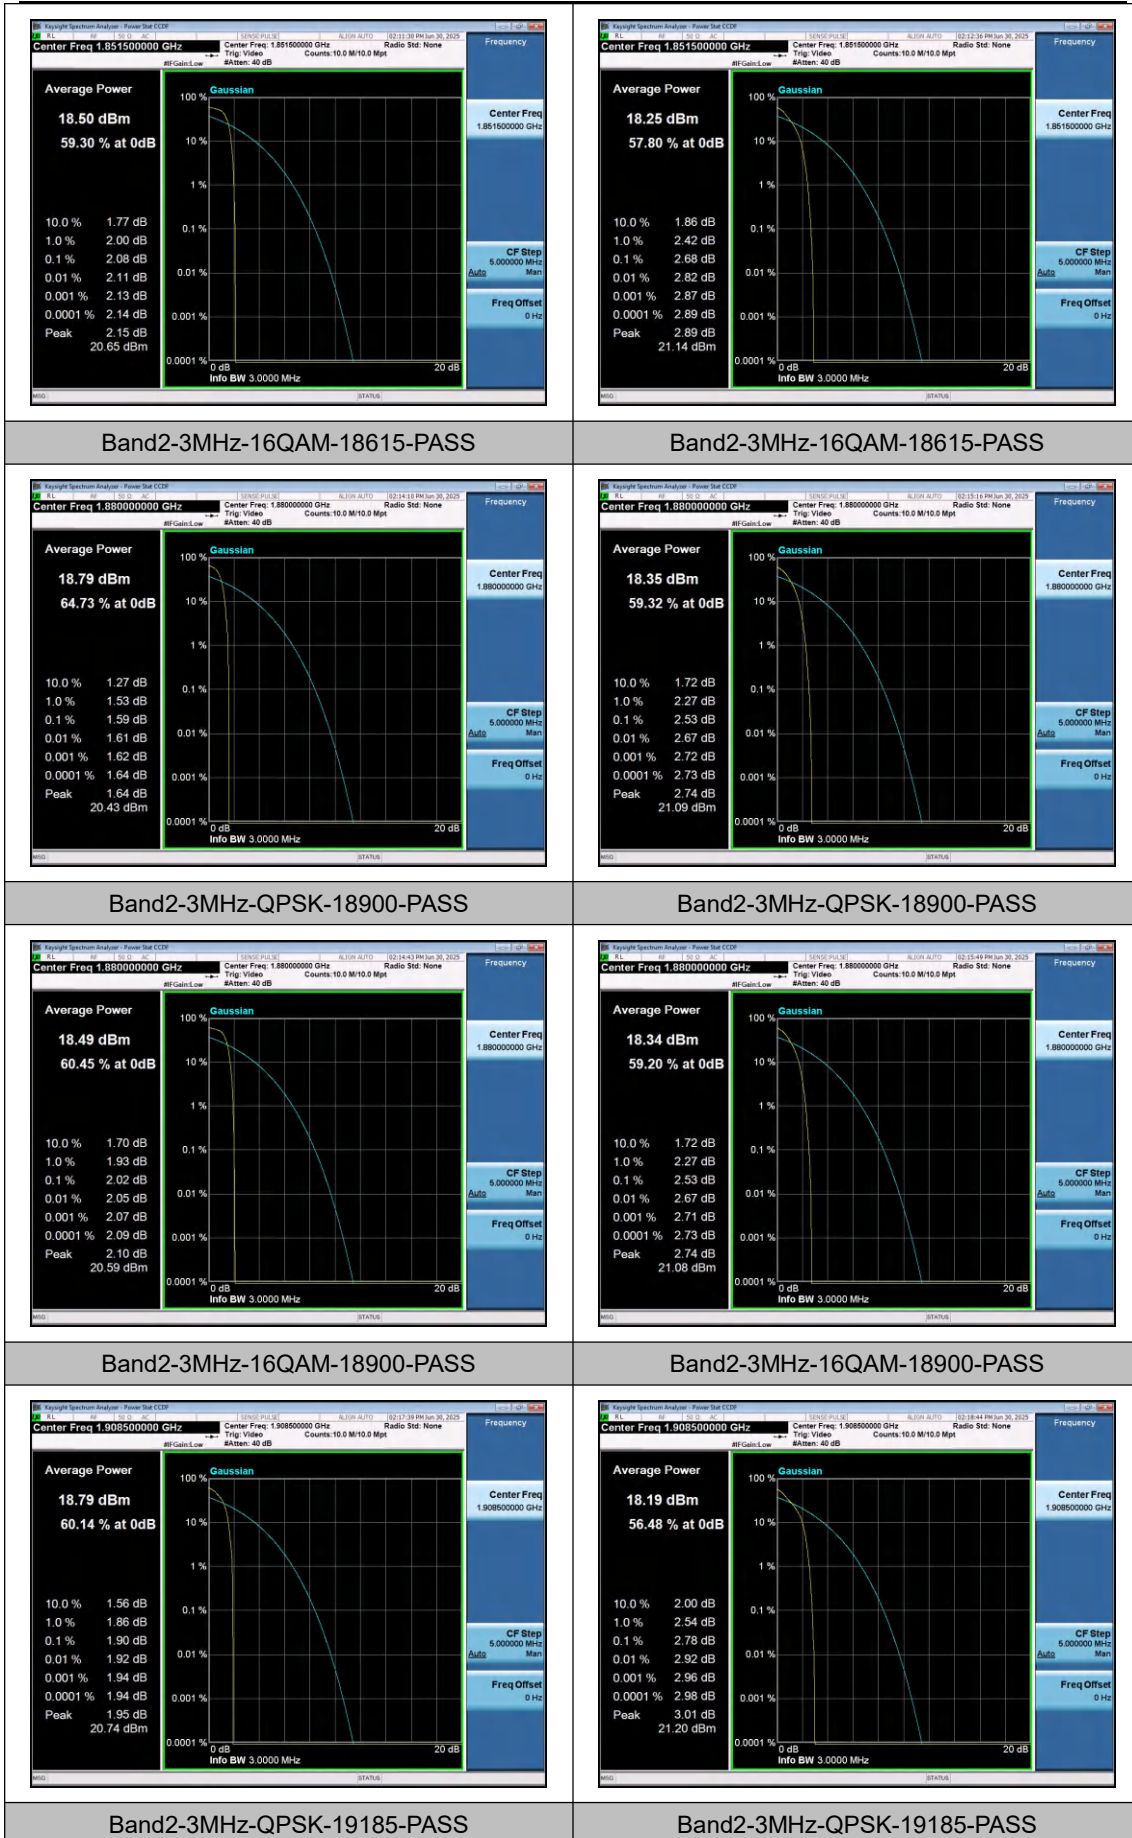


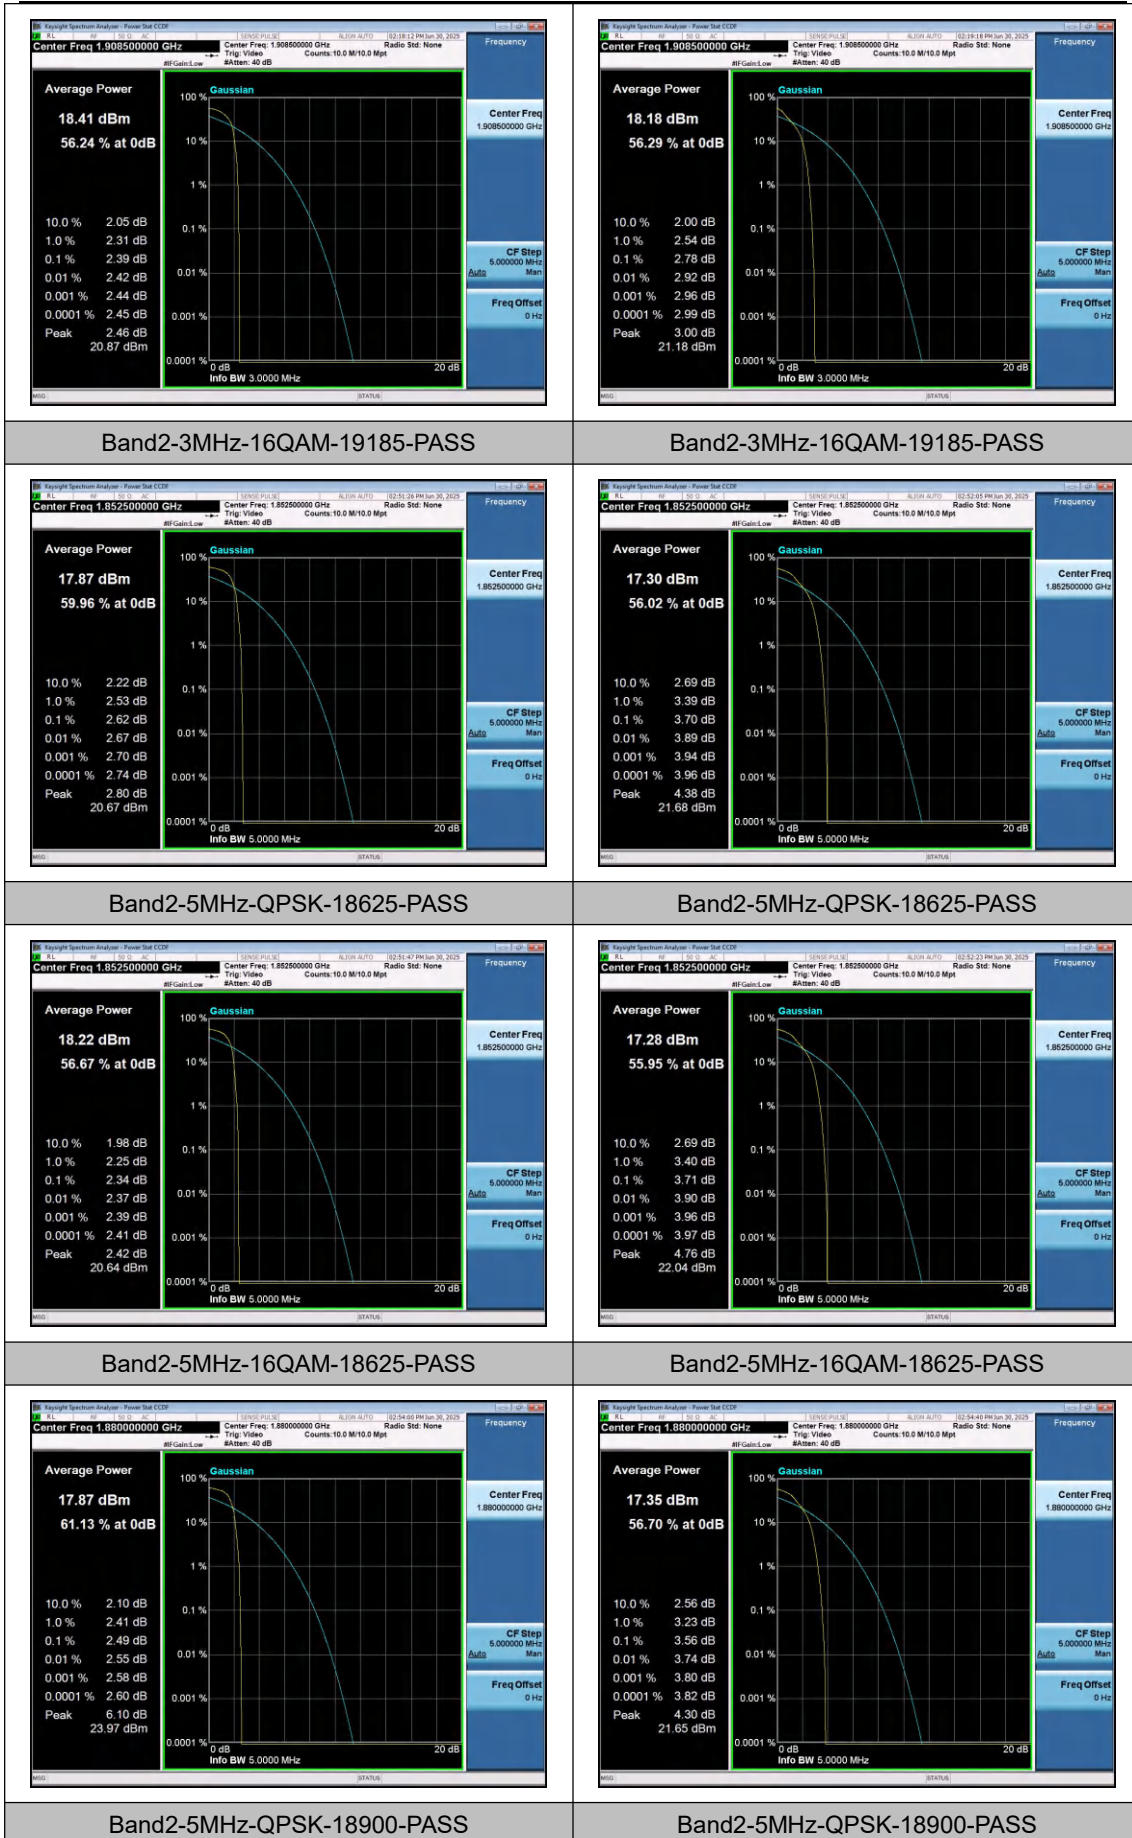

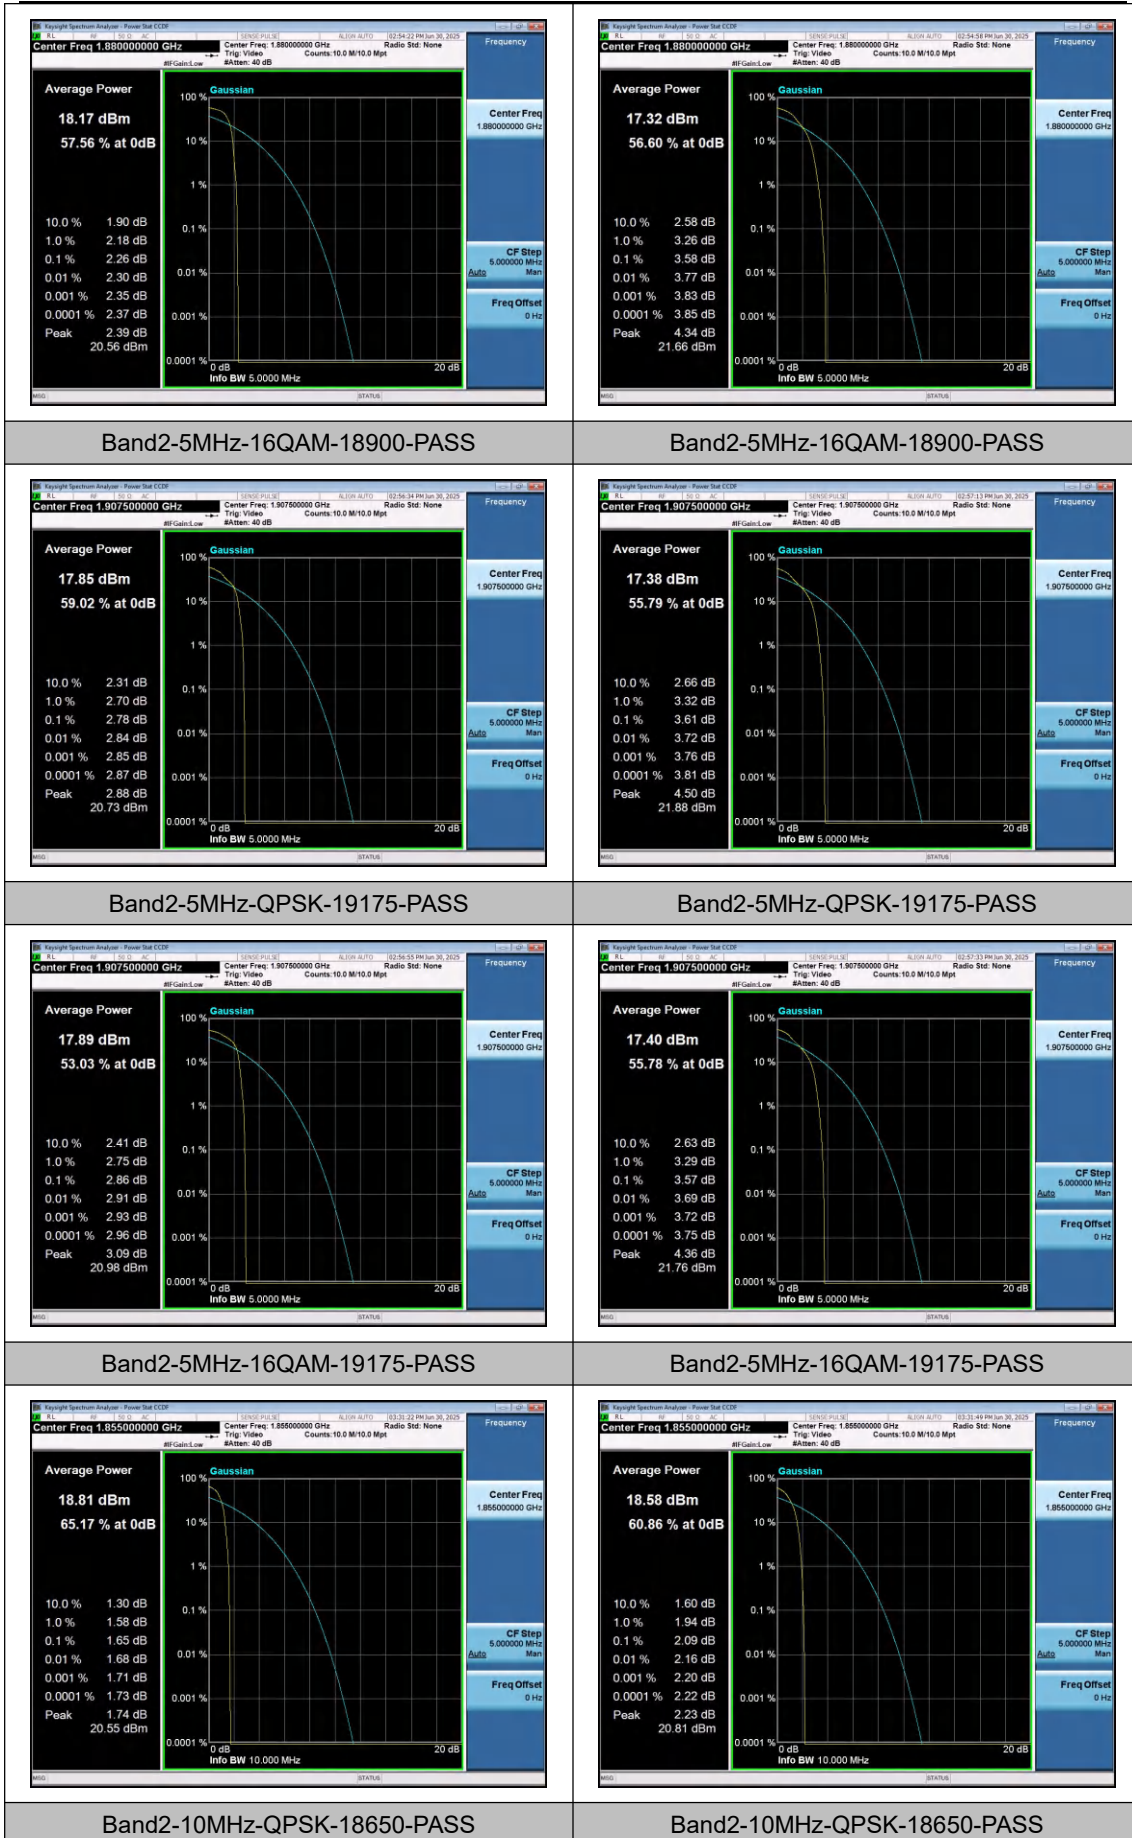


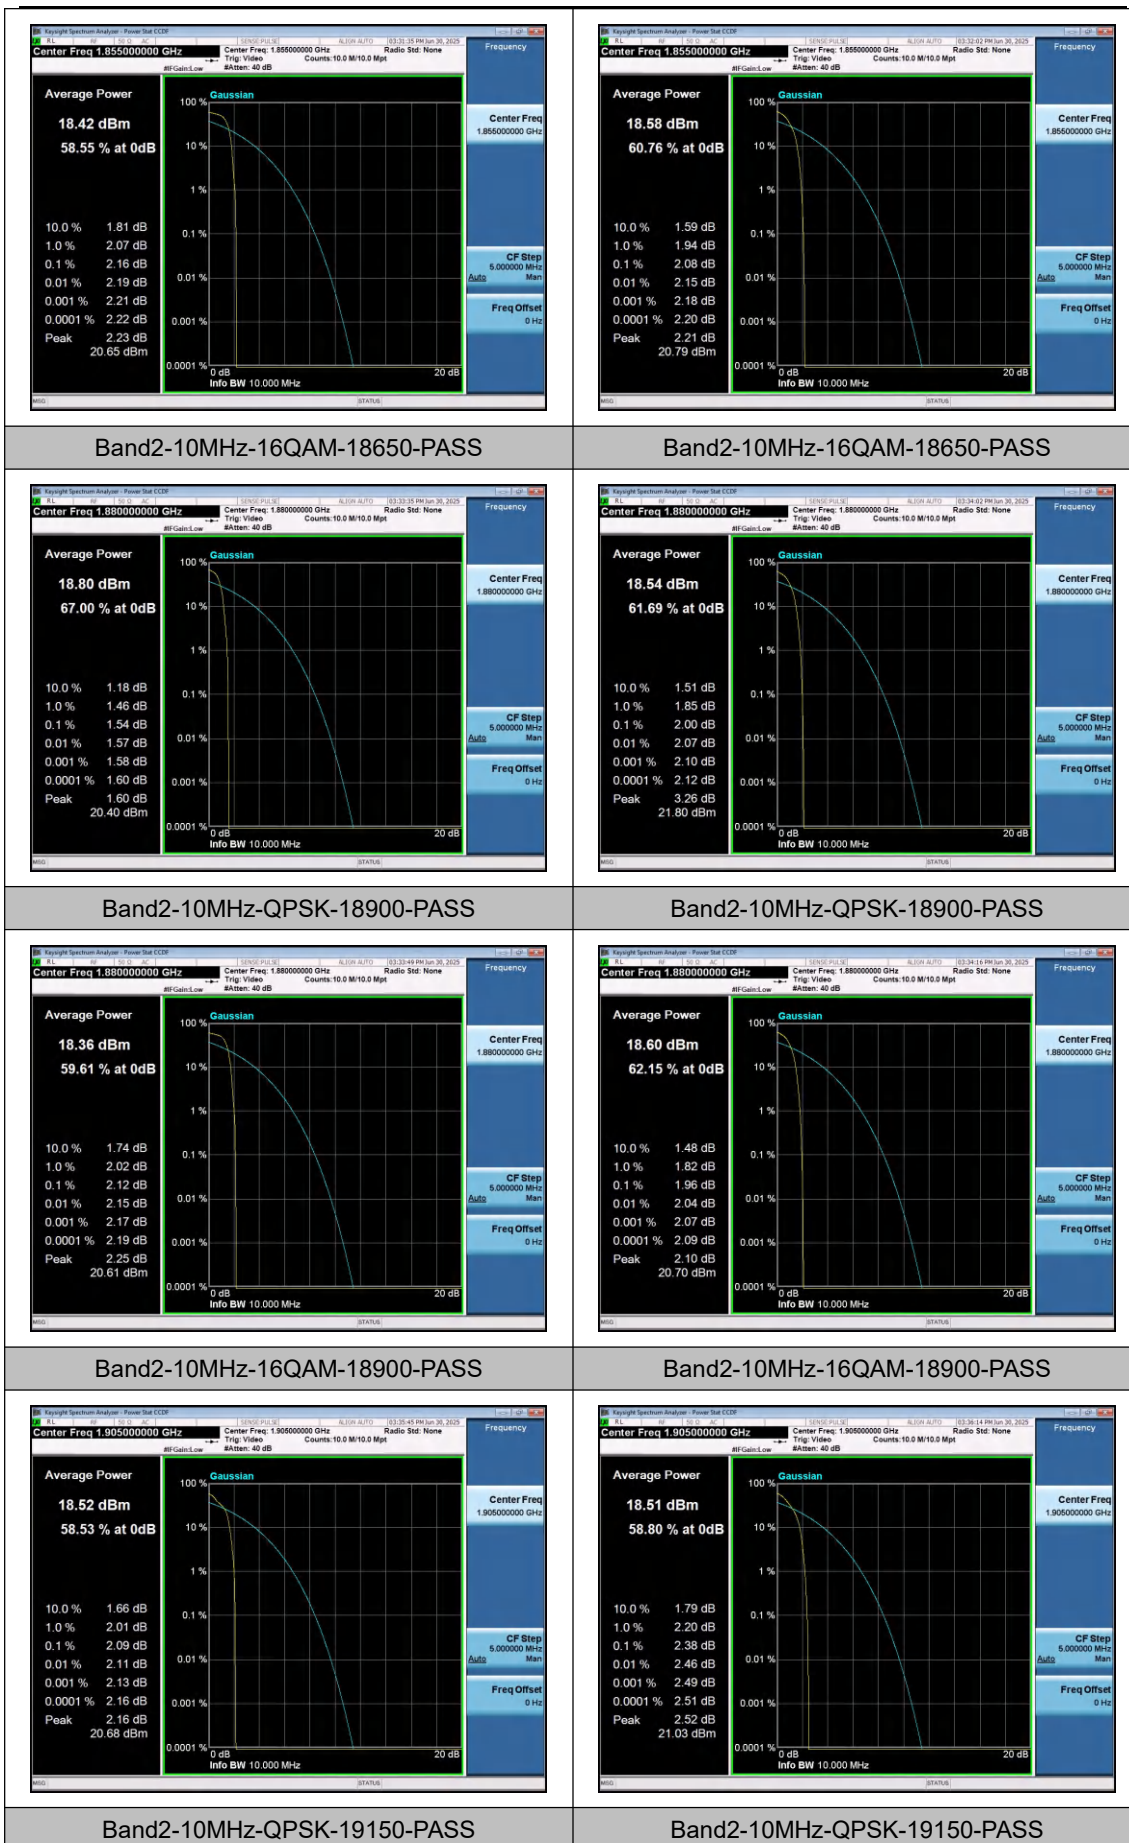

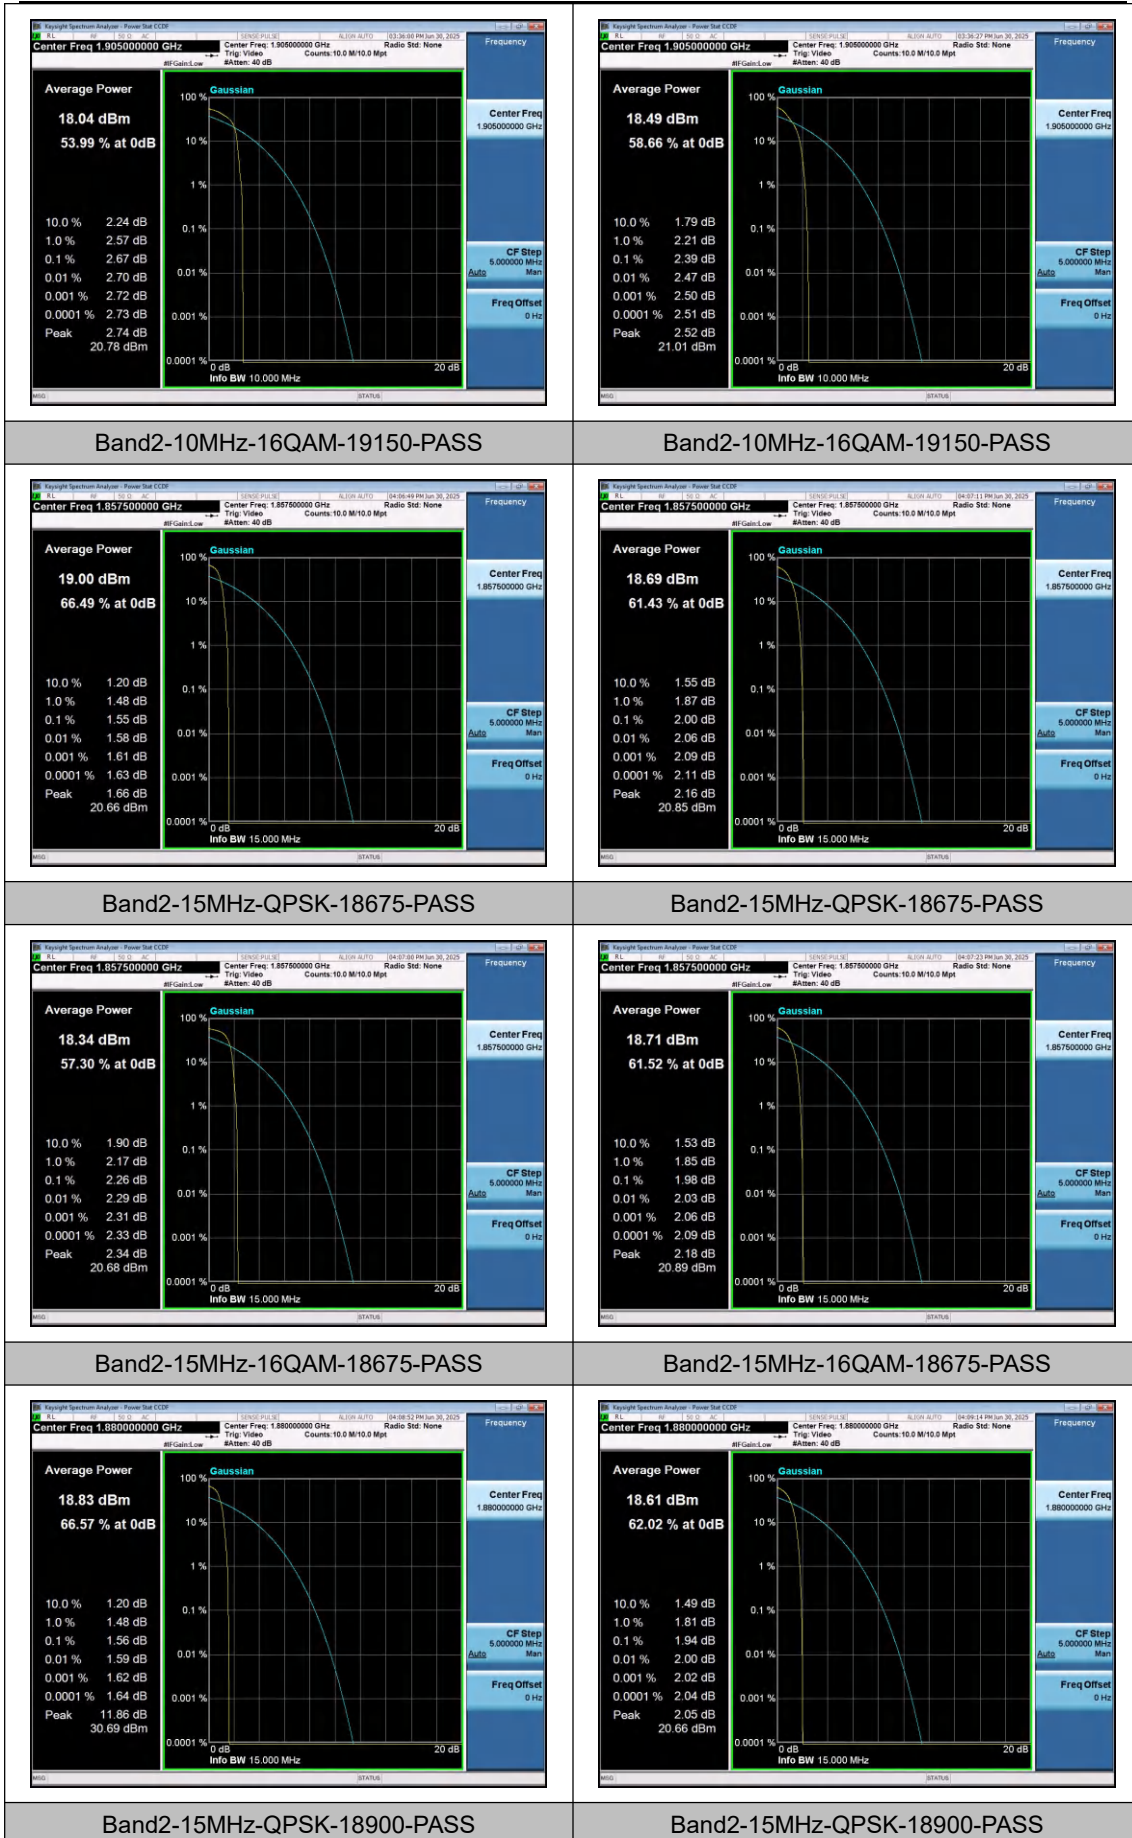

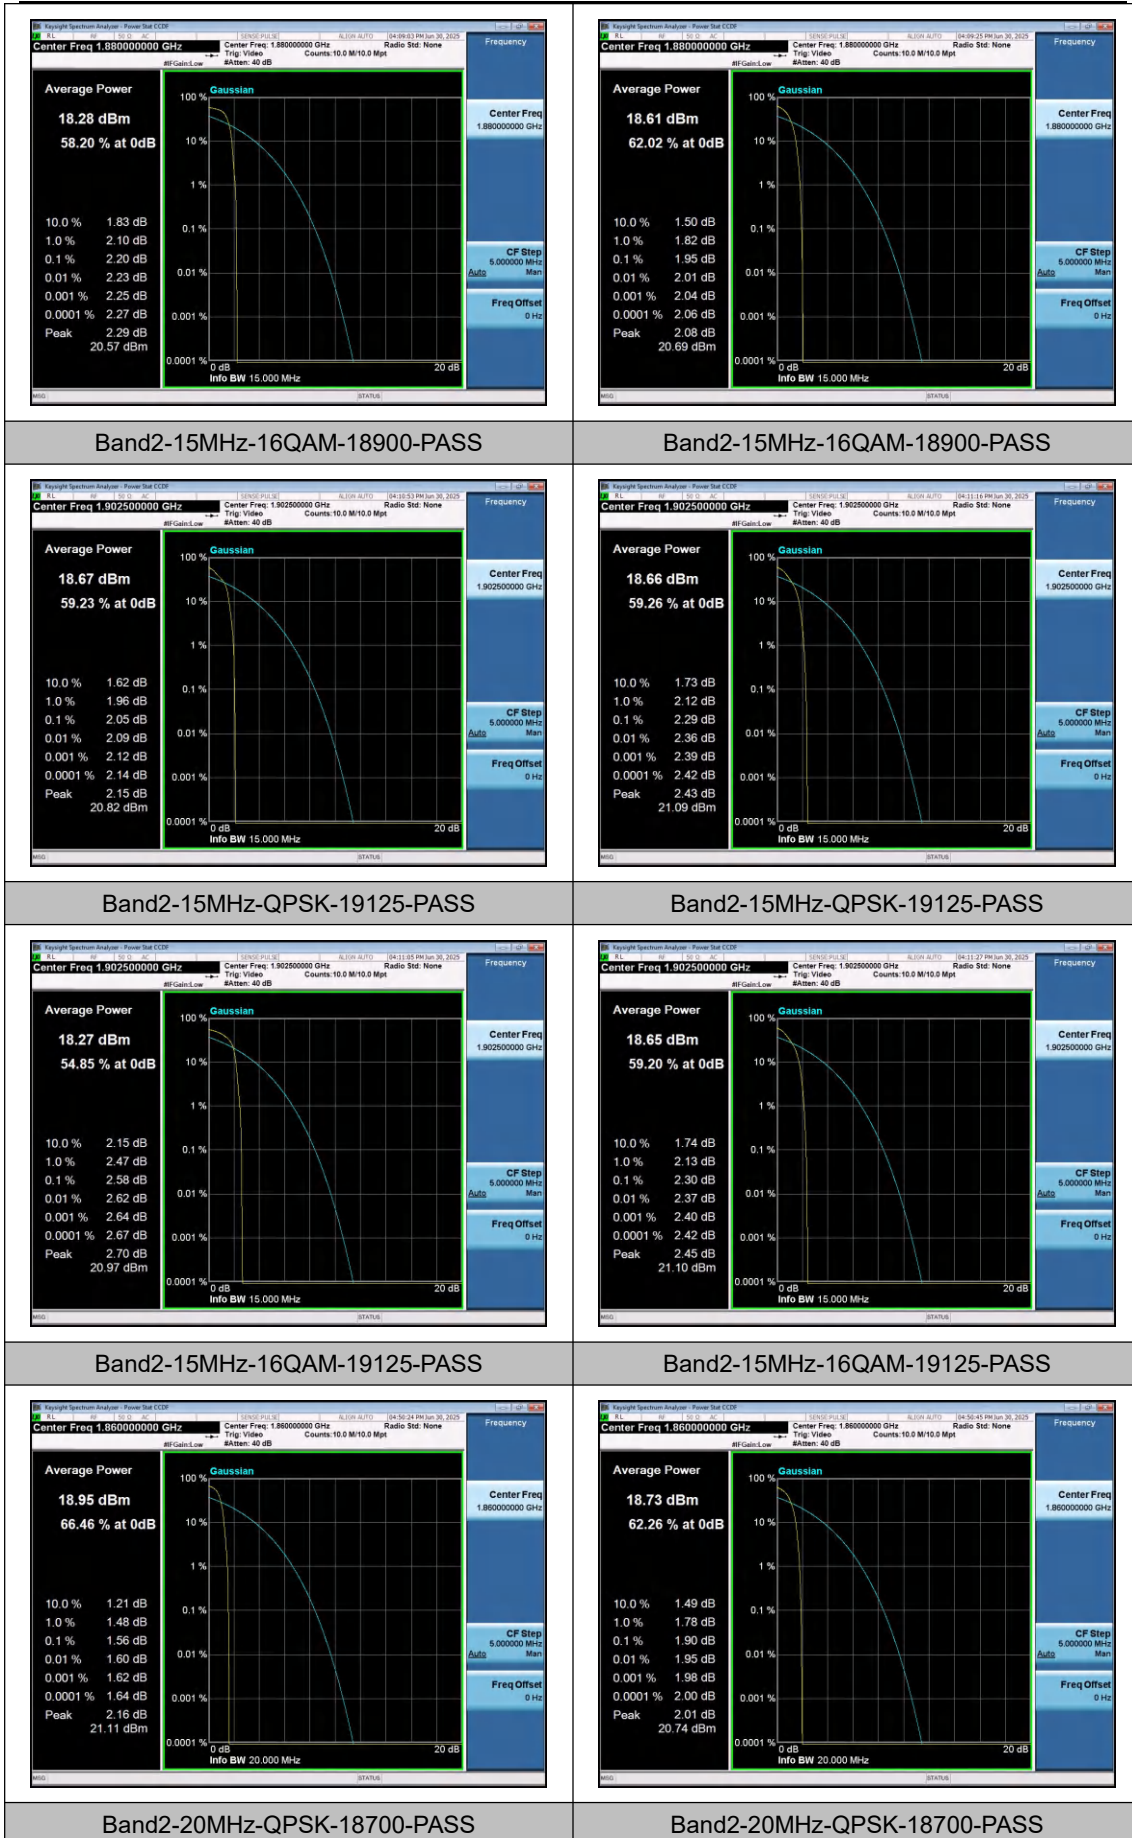



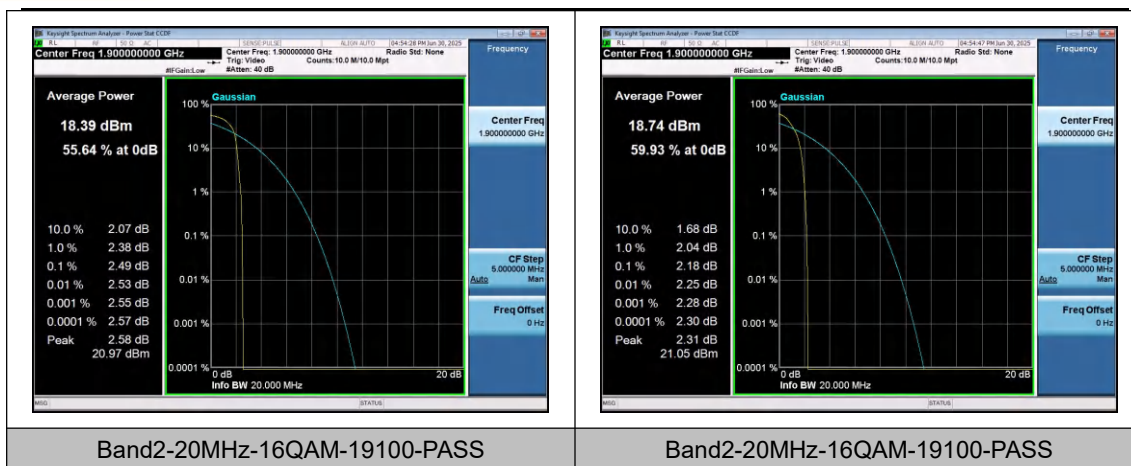

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: 26dB Bandwidth and Occupied Bandwidth for M1

Test Result


Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6	0	Low	1.1188	1.981	PASS
Band2	1.4MHz	16QAM	18607	6	0	Low	1.1241	1.993	PASS
Band2	1.4MHz	QPSK	18900	6	0	Low	1.1265	1.995	PASS
Band2	1.4MHz	16QAM	18900	6	0	Low	1.1238	1.989	PASS
Band2	1.4MHz	QPSK	19193	6	0	High	1.1067	1.945	PASS
Band2	1.4MHz	16QAM	19193	6	0	High	1.1034	1.952	PASS
Band2	3MHz	QPSK	18615	6	0	Low	1.1941	2.248	PASS
Band2	3MHz	16QAM	18615	6	0	Low	1.2020	2.238	PASS
Band2	3MHz	QPSK	18900	6	0	Low	1.3076	2.278	PASS
Band2	3MHz	16QAM	18900	6	0	Low	1.3011	2.271	PASS
Band2	3MHz	QPSK	19185	6	0	High	1.1721	2.130	PASS
Band2	3MHz	16QAM	19185	6	0	High	1.1633	2.100	PASS
Band2	5MHz	QPSK	18625	6	0	Low	1.2713	2.297	PASS
Band2	5MHz	16QAM	18625	6	0	Low	1.2739	2.299	PASS
Band2	5MHz	QPSK	18900	6	0	Low	1.3188	2.692	PASS
Band2	5MHz	16QAM	18900	6	0	Low	1.3097	2.366	PASS
Band2	5MHz	QPSK	19175	6	0	High	1.2491	2.275	PASS
Band2	5MHz	16QAM	19175	6	0	High	1.2512	2.275	PASS
Band2	10MHz	QPSK	18650	6	0	Low	1.8034	3.018	PASS
Band2	10MHz	16QAM	18650	6	0	Low	1.7516	2.965	PASS
Band2	10MHz	QPSK	18900	6	0	Low	1.8484	2.995	PASS
Band2	10MHz	16QAM	18900	6	0	Low	1.8262	2.998	PASS
Band2	10MHz	QPSK	19150	6	0	High	1.5923	2.912	PASS
Band2	10MHz	16QAM	19150	6	0	High	1.5552	2.942	PASS
Band2	15MHz	QPSK	18675	6	0	Low	2.0585	3.297	PASS
Band2	15MHz	16QAM	18675	6	0	Low	2.0452	3.197	PASS
Band2	15MHz	QPSK	18900	6	0	Low	2.0463	3.155	PASS
Band2	15MHz	16QAM	18900	6	0	Low	2.0107	3.158	PASS
Band2	15MHz	QPSK	19125	6	0	High	1.9952	3.556	PASS
Band2	15MHz	16QAM	19125	6	0	High	2.0002	3.452	PASS
Band2	20MHz	QPSK	18700	6	0	Low	2.7582	5.246	PASS
Band2	20MHz	16QAM	18700	6	0	Low	2.6547	5.091	PASS
Band2	20MHz	QPSK	18900	6	0	Low	2.8233	5.272	PASS
Band2	20MHz	16QAM	18900	6	0	Low	2.7362	5.204	PASS
Band2	20MHz	QPSK	19100	6	0	High	2.9260	5.391	PASS
Band2	20MHz	16QAM	19100	6	0	High	2.9707	5.648	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

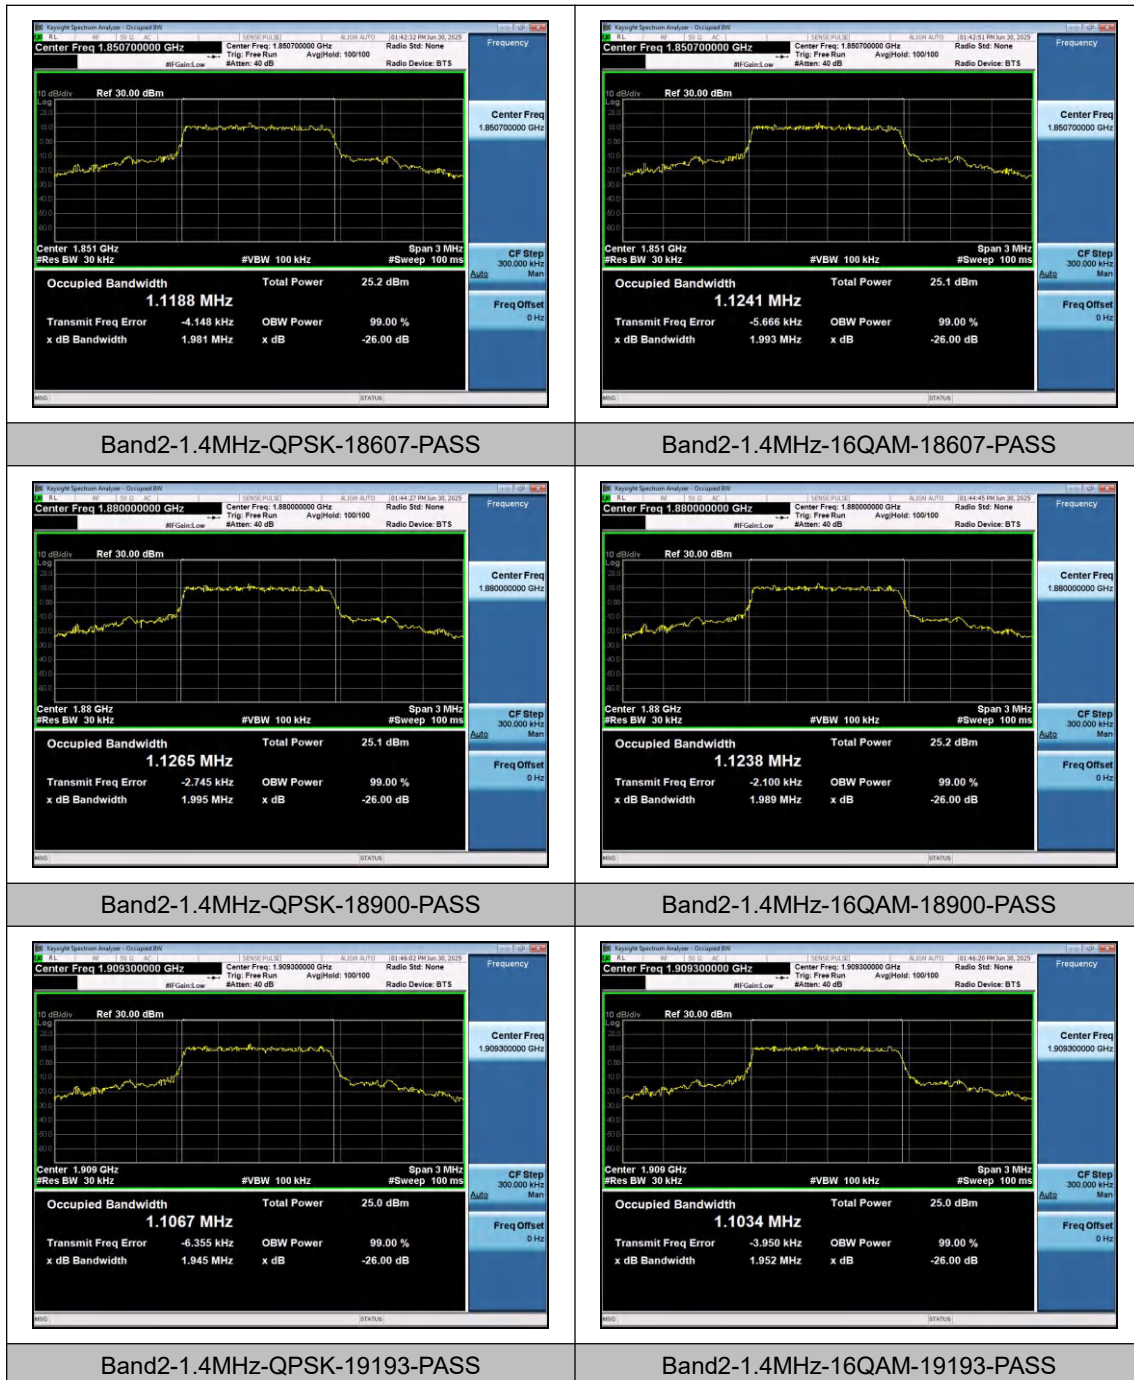

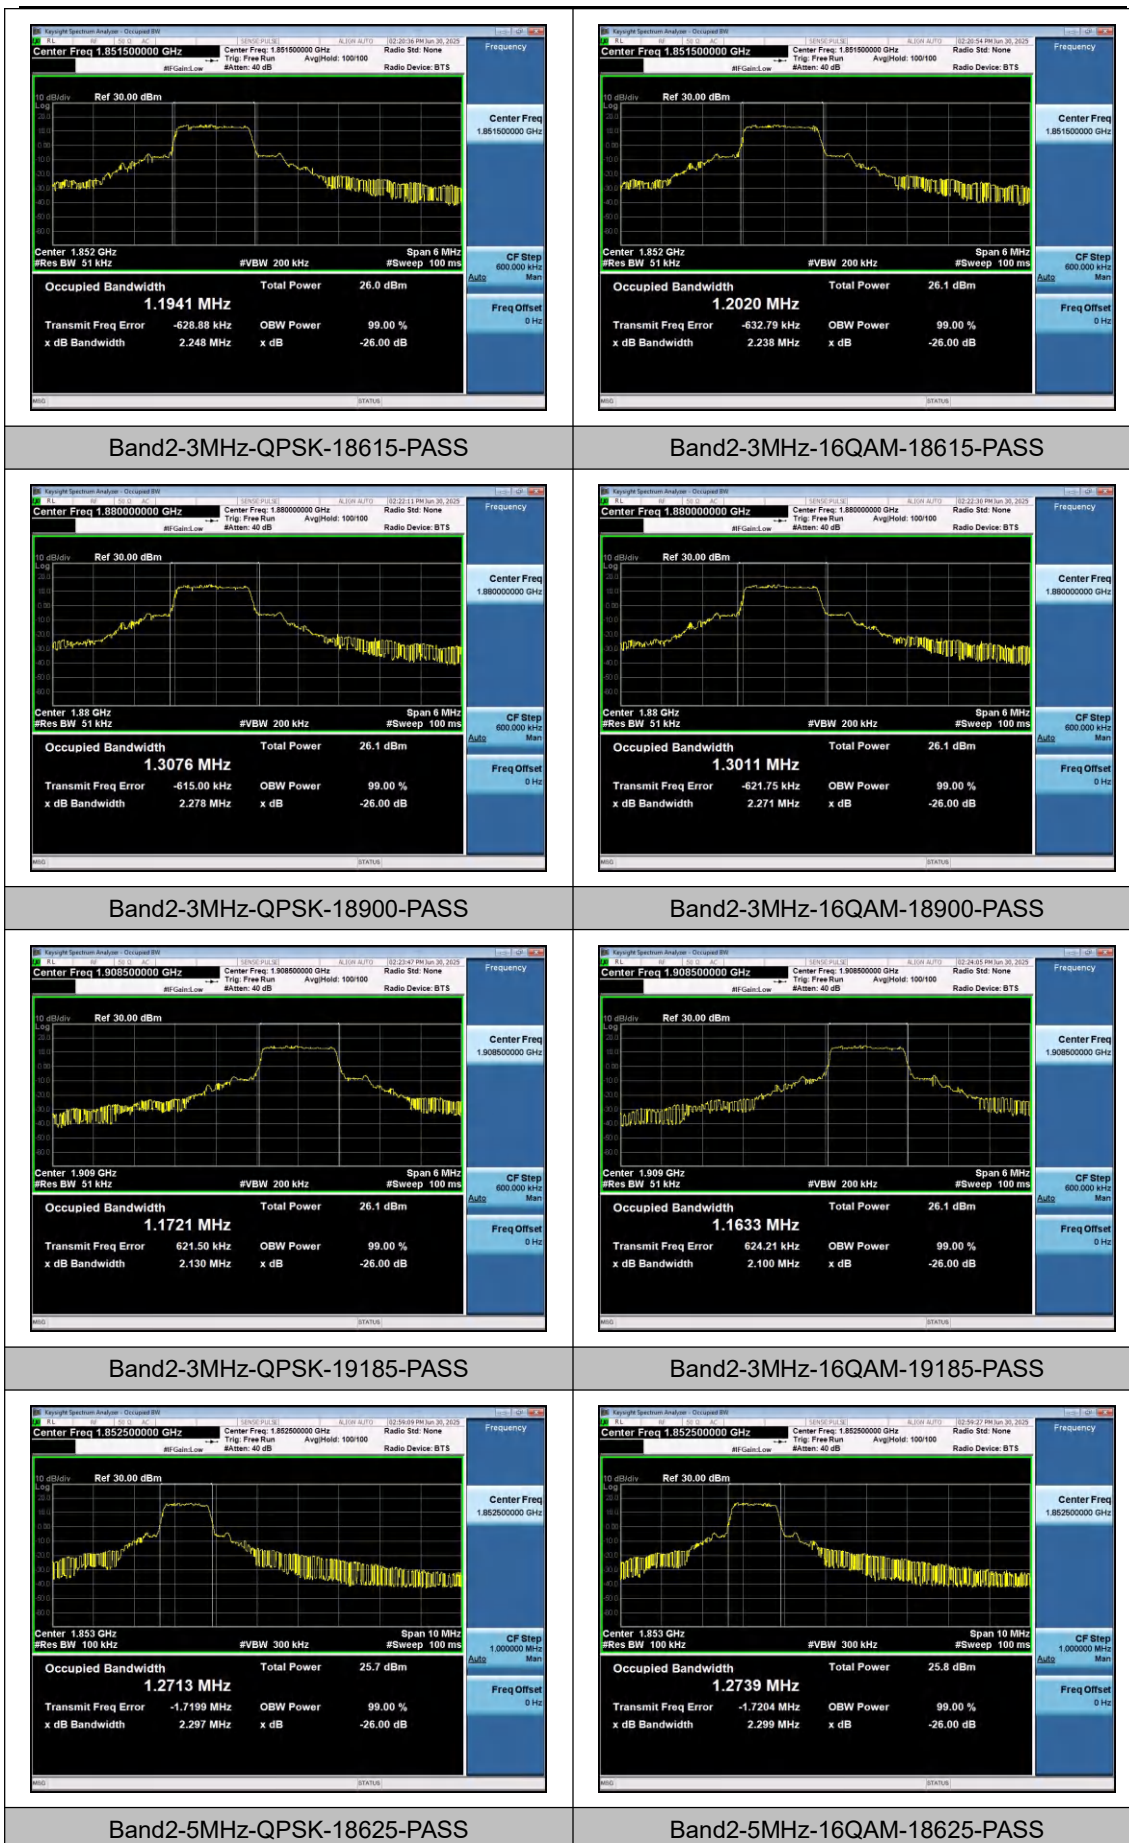

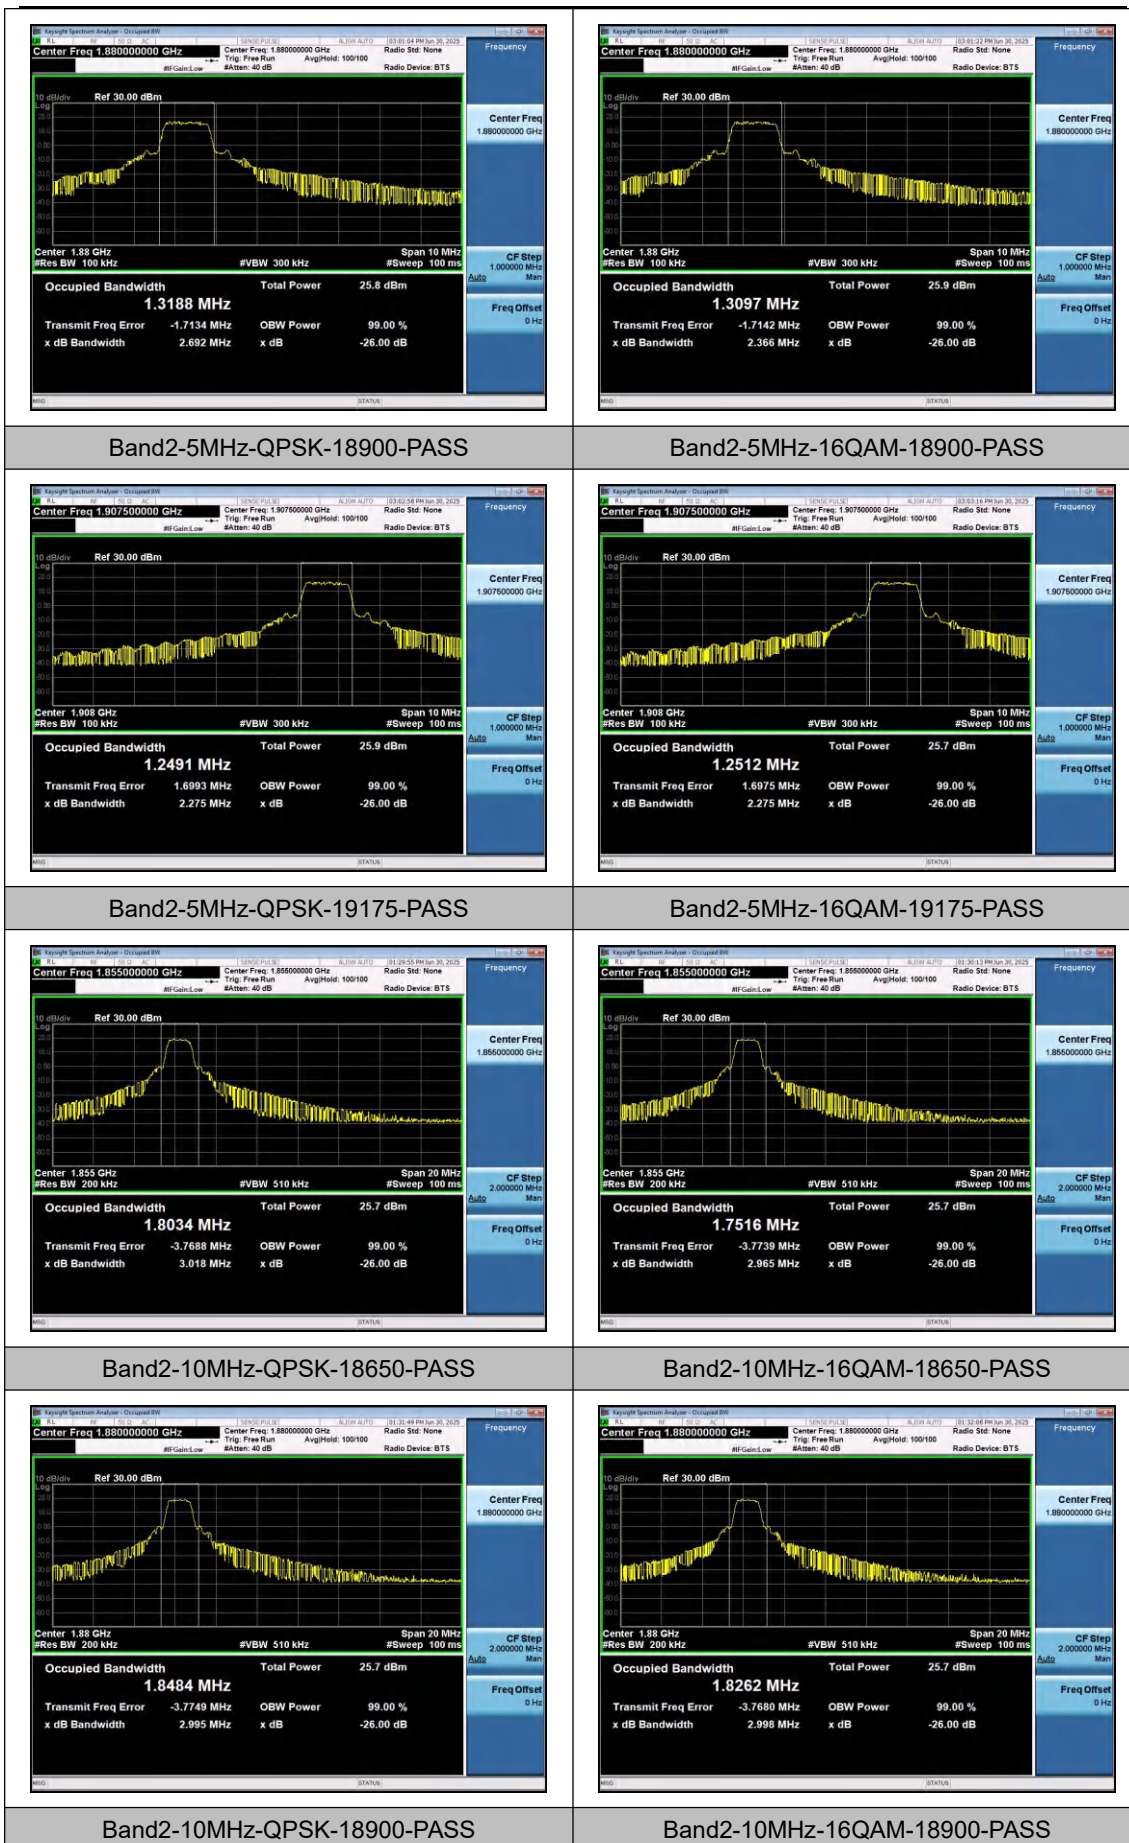

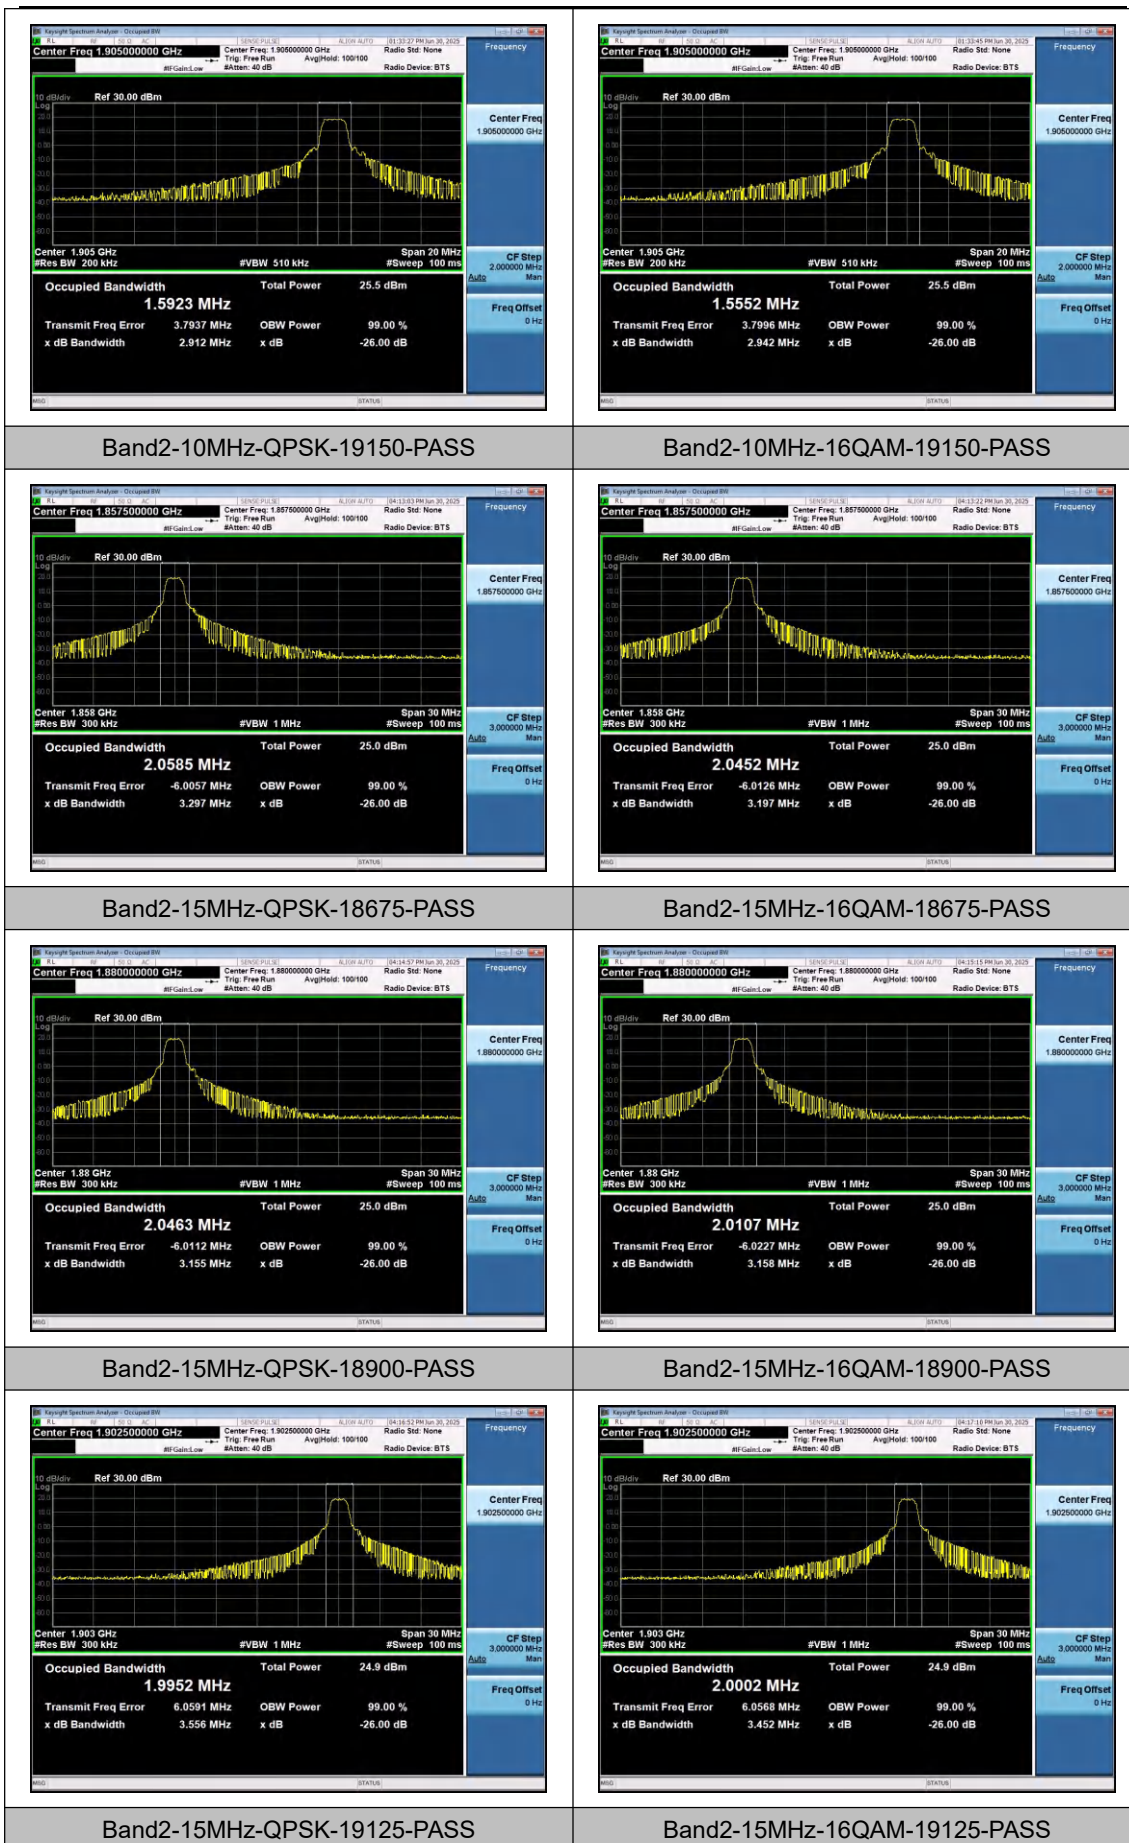

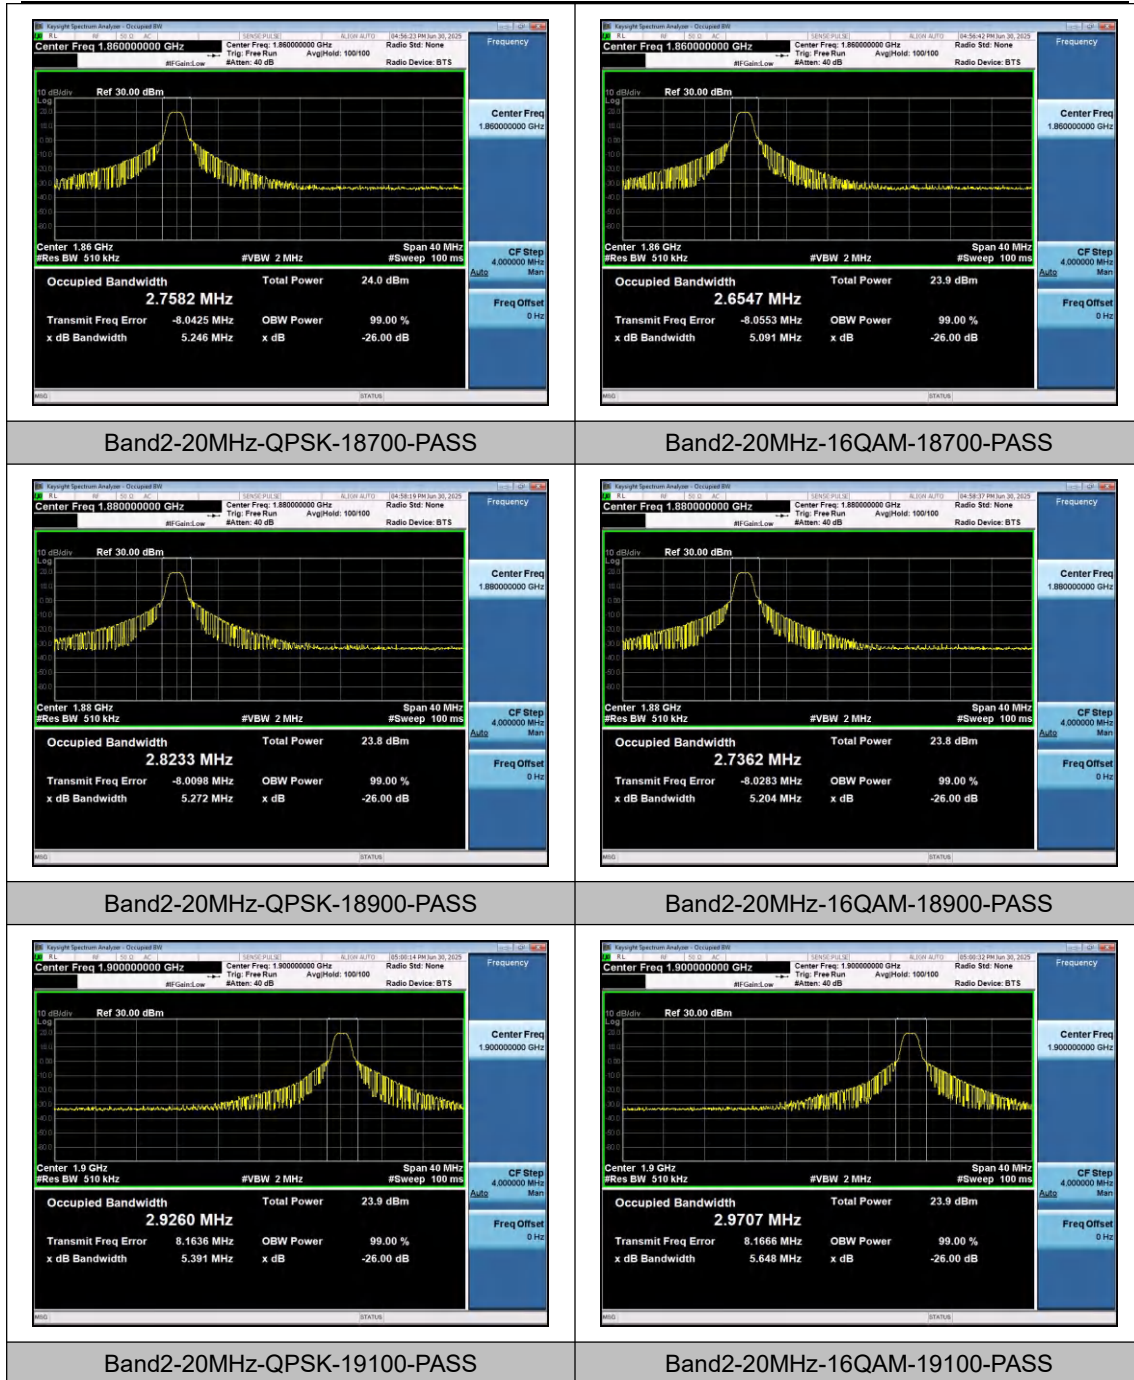

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Band Edge for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Result(dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1	0	Low	-24.40	PASS
Band2	1.4MHz	QPSK	18607	6	0	Low	-37.93	PASS
Band2	1.4MHz	16QAM	18607	1	0	Low	-26.21	PASS
Band2	1.4MHz	16QAM	18607	6	0	Low	-29.12	PASS
Band2	1.4MHz	QPSK	19193	1	5	High	-41.86	PASS
Band2	1.4MHz	QPSK	19193	6	0	High	-48.09	PASS
Band2	1.4MHz	16QAM	19193	1	5	High	-39.96	PASS
Band2	1.4MHz	16QAM	19193	6	0	High	-40.40	PASS
Band2	3MHz	QPSK	18615	1	0	Low	-41.77	PASS
Band2	3MHz	QPSK	18615	6	0	Low	-32.62	PASS
Band2	3MHz	16QAM	18615	1	0	Low	-43.85	PASS
Band2	3MHz	16QAM	18615	6	0	Low	-37.92	PASS
Band2	3MHz	QPSK	19185	1	5	High	-58.58	PASS
Band2	3MHz	QPSK	19185	6	0	High	-54.28	PASS
Band2	3MHz	16QAM	19185	1	5	High	-58.46	PASS
Band2	3MHz	16QAM	19185	6	0	High	-47.82	PASS
Band2	5MHz	QPSK	18625	1	0	Low	-35.13	PASS
Band2	5MHz	QPSK	18625	6	0	Low	-28.36	PASS
Band2	5MHz	16QAM	18625	1	0	Low	-40.06	PASS
Band2	5MHz	16QAM	18625	6	0	Low	-31.90	PASS
Band2	5MHz	QPSK	19175	1	5	High	-51.90	PASS
Band2	5MHz	QPSK	19175	6	0	High	-31.94	PASS
Band2	5MHz	16QAM	19175	1	5	High	-52.20	PASS
Band2	5MHz	16QAM	19175	6	0	High	-34.11	PASS
Band2	10MHz	QPSK	18650	1	0	Low	-51.19	PASS
Band2	10MHz	QPSK	18650	6	0	Low	-32.33	PASS
Band2	10MHz	16QAM	18650	1	0	Low	-55.50	PASS
Band2	10MHz	16QAM	18650	6	0	Low	-26.38	PASS
Band2	10MHz	QPSK	19150	1	5	High	-56.00	PASS
Band2	10MHz	QPSK	19150	6	0	High	-30.21	PASS
Band2	10MHz	16QAM	19150	1	5	High	-55.02	PASS
Band2	10MHz	16QAM	19150	6	0	High	-30.77	PASS
Band2	15MHz	QPSK	18675	1	0	Low	-52.81	PASS
Band2	15MHz	QPSK	18675	6	0	Low	-35.41	PASS
Band2	15MHz	16QAM	18675	1	0	Low	-53.27	PASS
Band2	15MHz	16QAM	18675	6	0	Low	-36.22	PASS
Band2	15MHz	QPSK	19125	1	5	High	-54.80	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band2	15MHz	QPSK	19125	6	0	High	-35.27	PASS
Band2	15MHz	16QAM	19125	1	5	High	-54.13	PASS
Band2	15MHz	16QAM	19125	6	0	High	-36.85	PASS
Band2	20MHz	QPSK	18700	1	0	Low	-52.85	PASS
Band2	20MHz	QPSK	18700	6	0	Low	-39.65	PASS
Band2	20MHz	16QAM	18700	1	0	Low	-53.94	PASS
Band2	20MHz	16QAM	18700	6	0	Low	-41.46	PASS
Band2	20MHz	QPSK	19100	1	5	High	-53.44	PASS
Band2	20MHz	QPSK	19100	6	0	High	-38.02	PASS
Band2	20MHz	16QAM	19100	6	0	High	-46.12	PASS
Band2	20MHz	16QAM	19100	1	5	High	-53.55	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

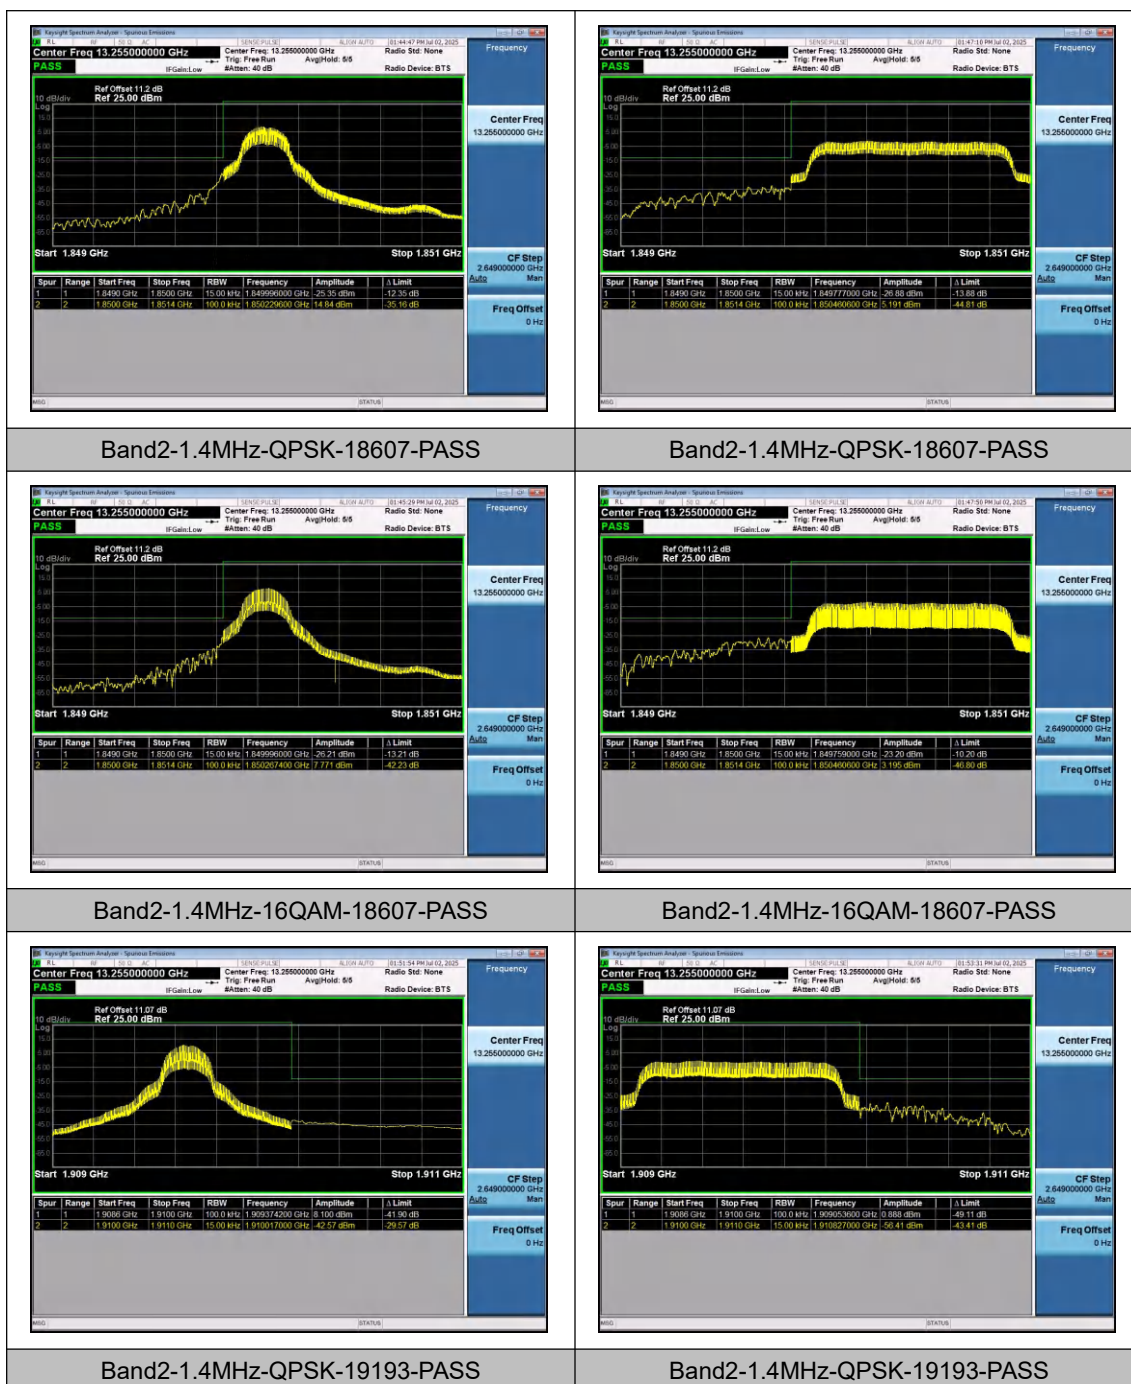


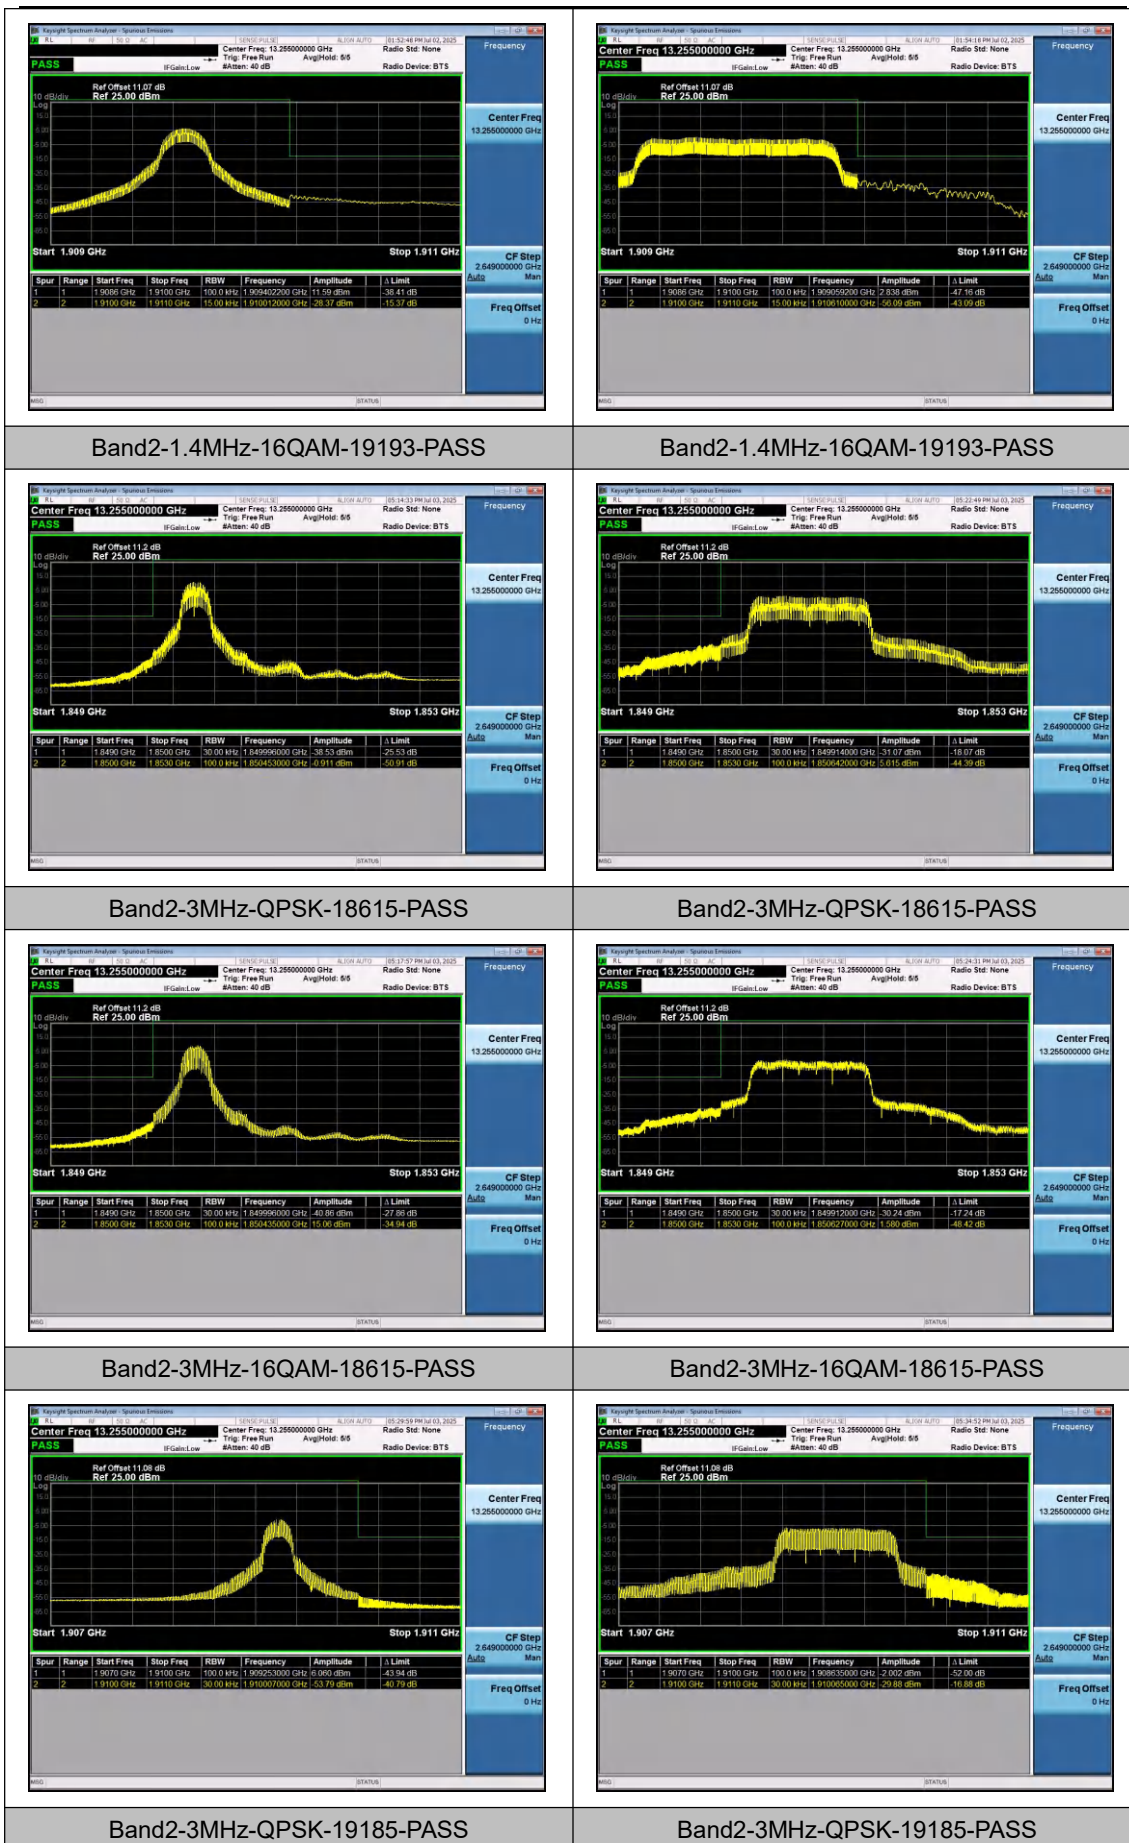


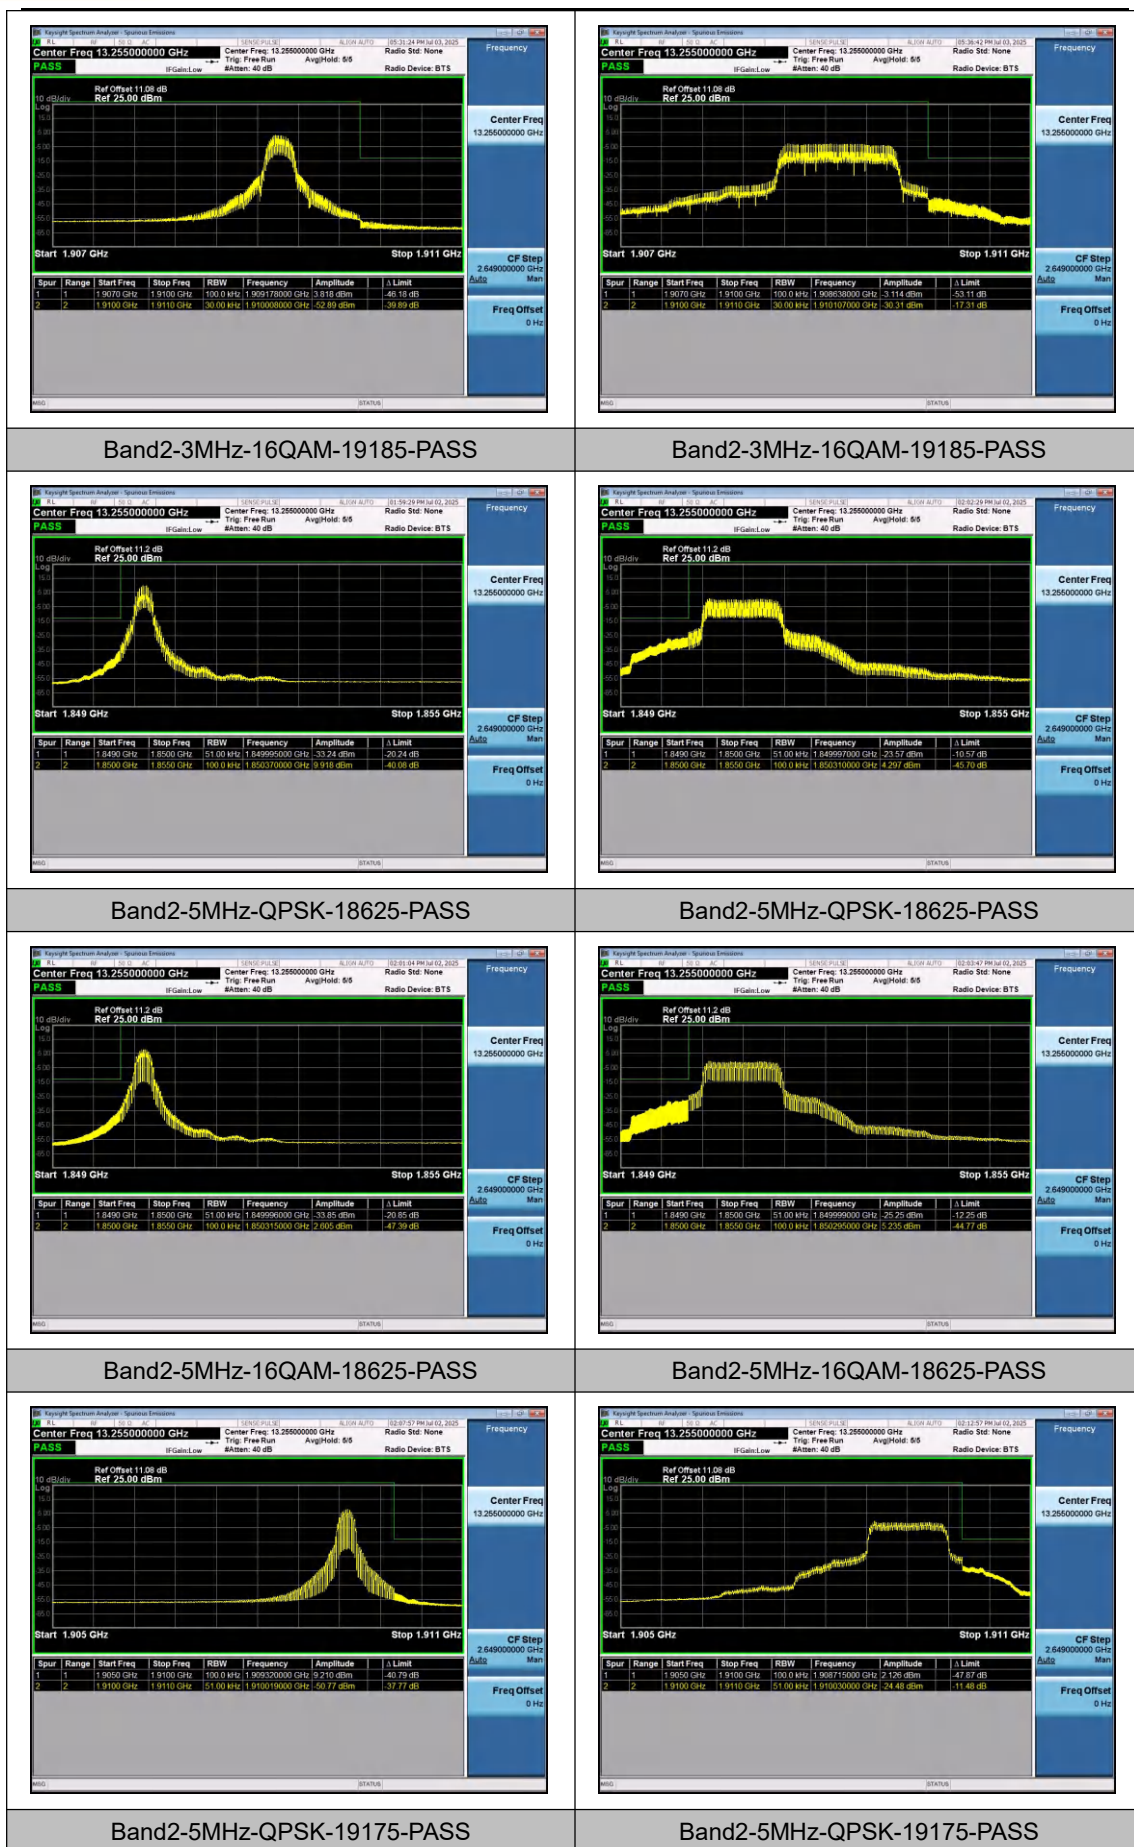

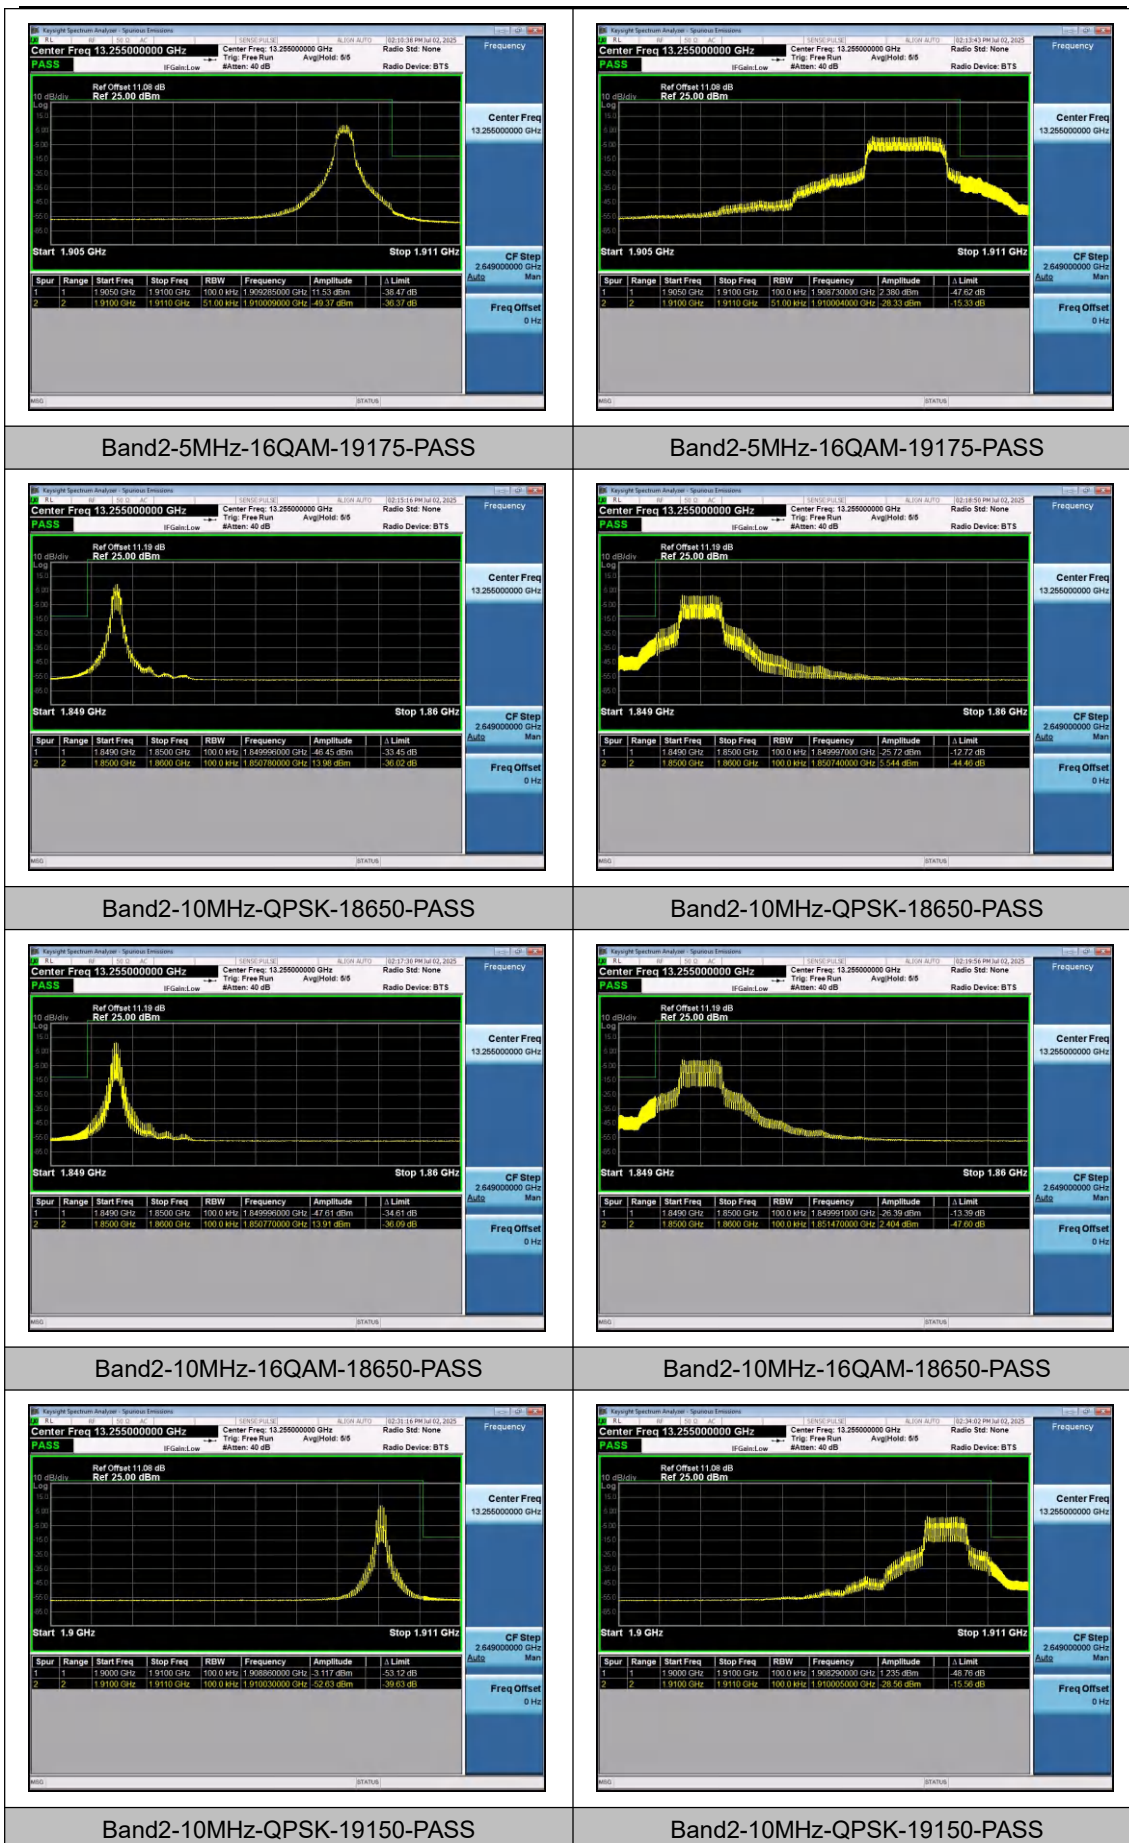

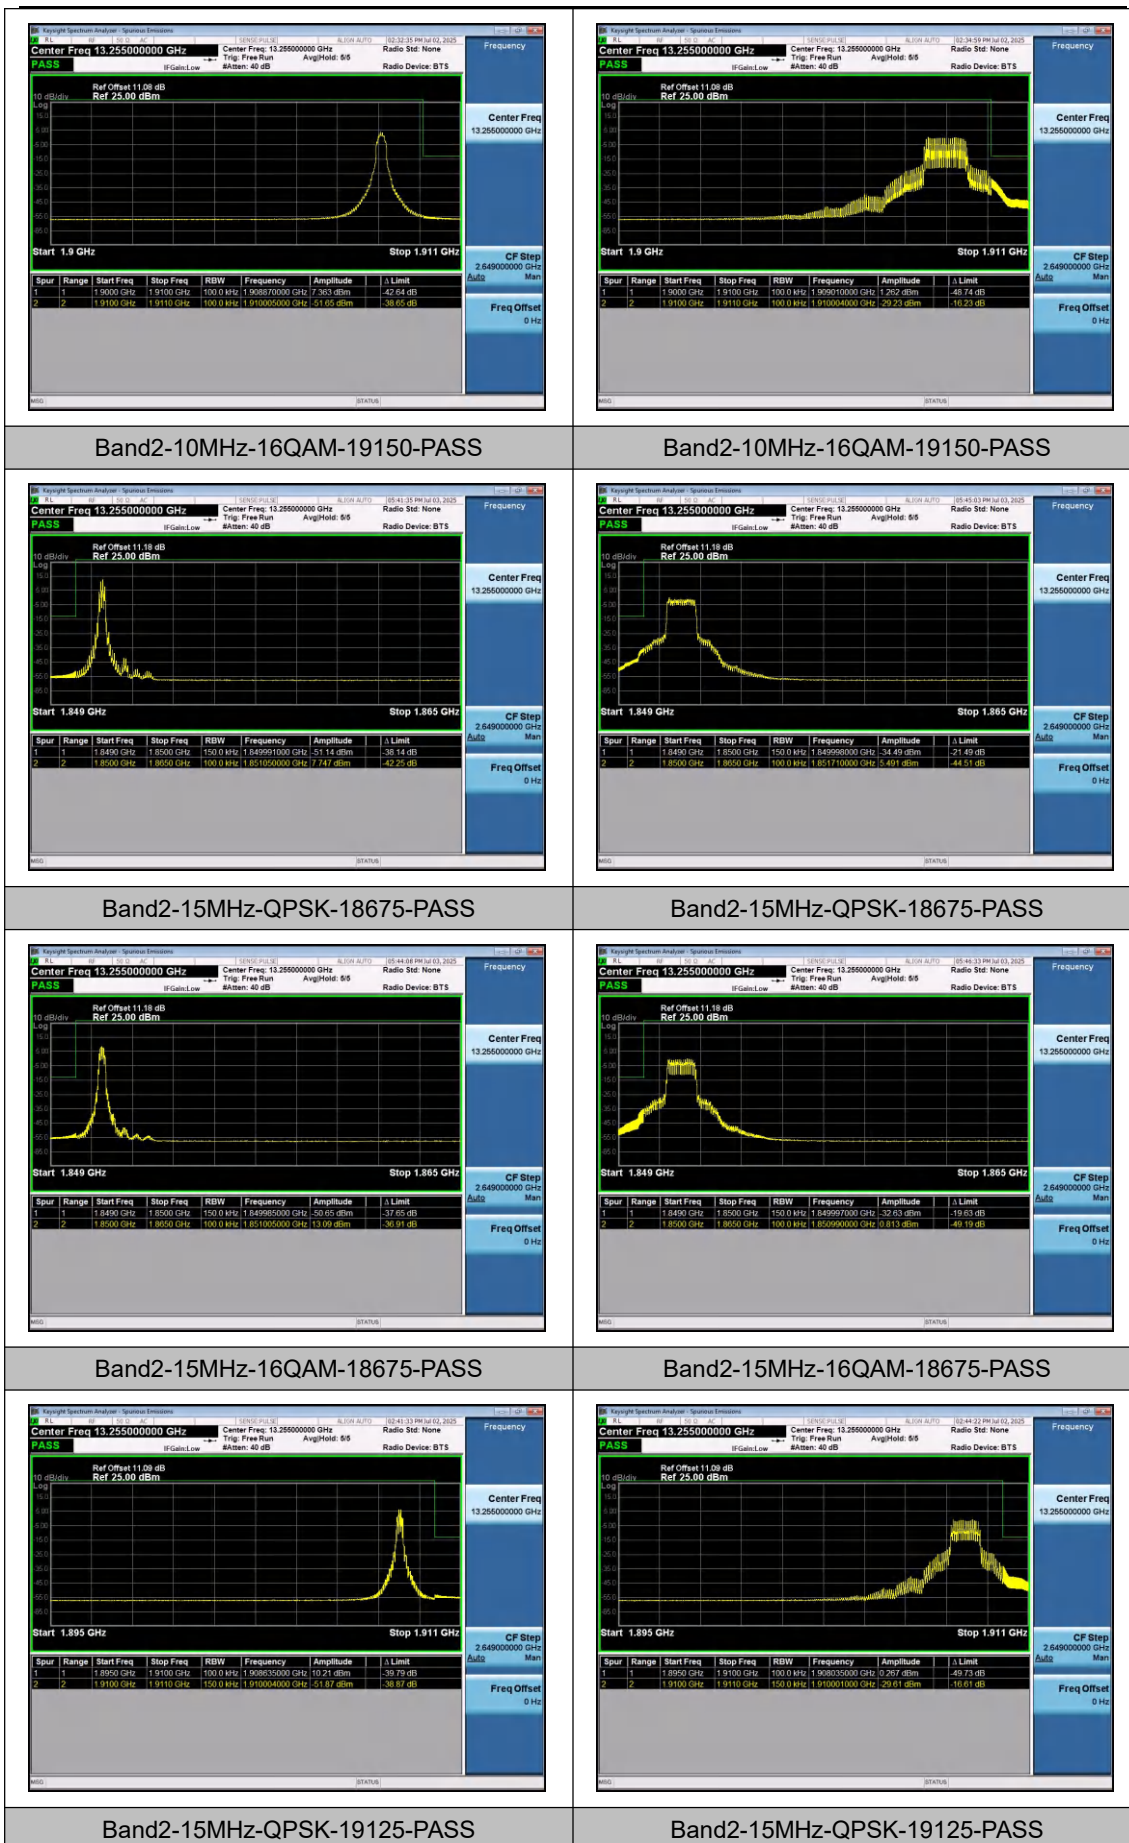

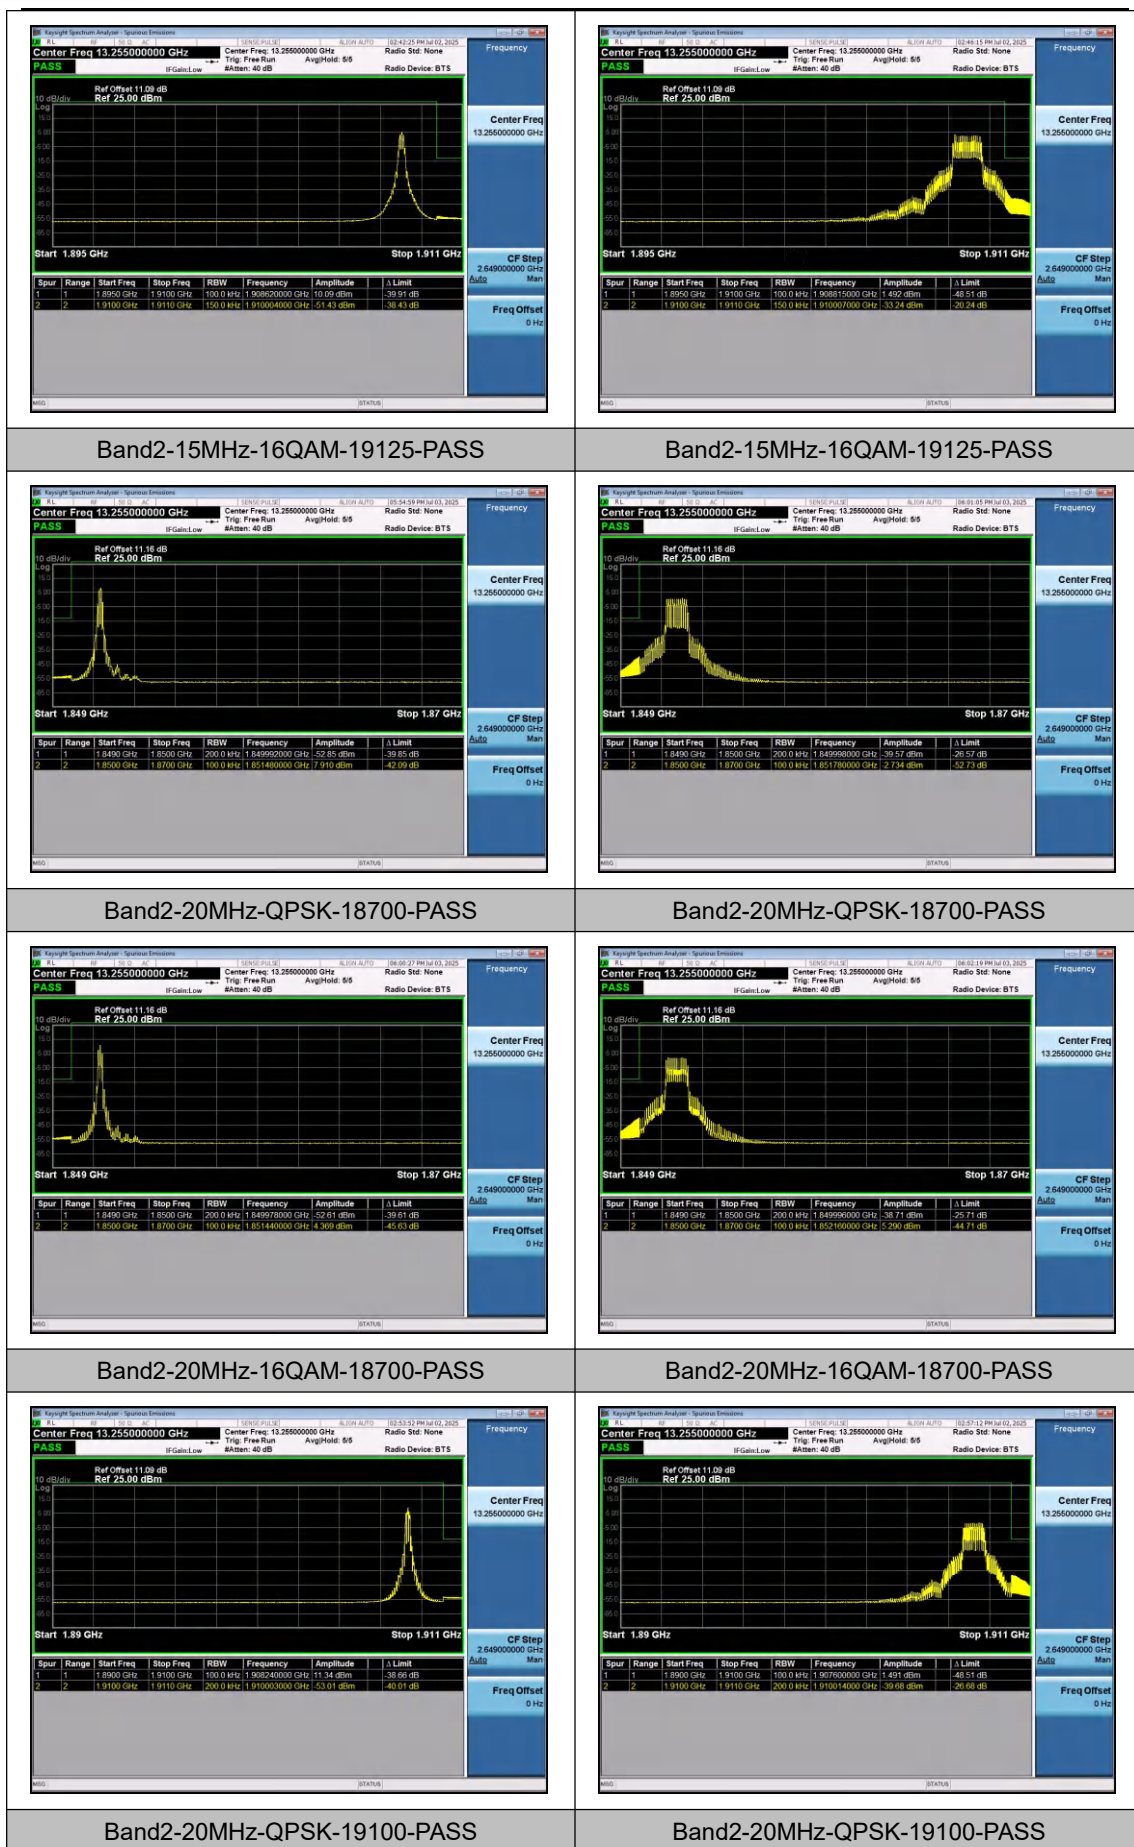

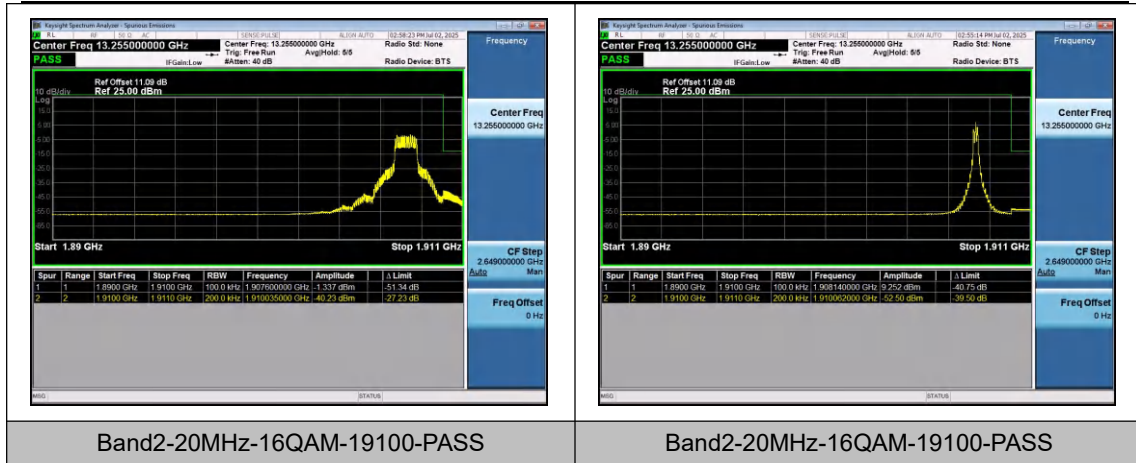

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Conducted Spurious Emission for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Start Freq	Stop Freq	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1	0	Low	0.009	0.15	-63.76	PASS
Band2	1.4MHz	QPSK	18607	1	0	Low	0.15	30	-63.87	PASS
Band2	1.4MHz	QPSK	18607	1	0	Low	30	1000	-50.62	PASS
Band2	1.4MHz	QPSK	18607	1	0	Low	1000	20000	-40.75	PASS
Band2	1.4MHz	16QAM	18607	1	0	Low	0.009	0.15	-61.75	PASS
Band2	1.4MHz	16QAM	18607	1	0	Low	0.15	30	-61.31	PASS
Band2	1.4MHz	16QAM	18607	1	0	Low	30	1000	-50.67	PASS
Band2	1.4MHz	16QAM	18607	1	0	Low	1000	20000	-41.12	PASS
Band2	1.4MHz	QPSK	18900	1	0	Low	0.009	0.15	-64.76	PASS
Band2	1.4MHz	QPSK	18900	1	0	Low	0.15	30	-64.02	PASS
Band2	1.4MHz	QPSK	18900	1	0	Low	30	1000	-50.69	PASS
Band2	1.4MHz	QPSK	18900	1	0	Low	1000	20000	-40.74	PASS
Band2	1.4MHz	16QAM	18900	1	0	Low	0.009	0.15	-68.34	PASS
Band2	1.4MHz	16QAM	18900	1	0	Low	0.15	30	-61.5	PASS
Band2	1.4MHz	16QAM	18900	1	0	Low	30	1000	-50.74	PASS
Band2	1.4MHz	16QAM	18900	1	0	Low	1000	20000	-40.56	PASS
Band2	1.4MHz	QPSK	19193	1	5	High	0.009	0.15	-67.52	PASS
Band2	1.4MHz	QPSK	19193	1	5	High	0.15	30	-65.35	PASS
Band2	1.4MHz	QPSK	19193	1	5	High	30	1000	-49.21	PASS
Band2	1.4MHz	QPSK	19193	1	5	High	1000	20000	-41.34	PASS
Band2	1.4MHz	16QAM	19193	1	5	High	0.009	0.15	-69.16	PASS
Band2	1.4MHz	16QAM	19193	1	5	High	0.15	30	-59.08	PASS
Band2	1.4MHz	16QAM	19193	1	5	High	30	1000	-50.81	PASS
Band2	1.4MHz	16QAM	19193	1	5	High	1000	20000	-40.97	PASS
Band2	3MHz	QPSK	18615	1	0	Low	0.009	0.15	-67.11	PASS
Band2	3MHz	QPSK	18615	1	0	Low	0.15	30	-61.55	PASS
Band2	3MHz	QPSK	18615	1	0	Low	30	1000	-50.63	PASS
Band2	3MHz	QPSK	18615	1	0	Low	1000	20000	-40.89	PASS
Band2	3MHz	16QAM	18615	1	0	Low	0.009	0.15	-63.14	PASS
Band2	3MHz	16QAM	18615	1	0	Low	0.15	30	-62.65	PASS
Band2	3MHz	16QAM	18615	1	0	Low	30	1000	-49.45	PASS
Band2	3MHz	16QAM	18615	1	0	Low	1000	20000	-40.92	PASS
Band2	3MHz	QPSK	18900	1	0	Low	0.009	0.15	-64.28	PASS
Band2	3MHz	QPSK	18900	1	0	Low	0.15	30	-64.45	PASS
Band2	3MHz	QPSK	18900	1	0	Low	30	1000	-50.72	PASS
Band2	3MHz	QPSK	18900	1	0	Low	1000	20000	-40.09	PASS
Band2	3MHz	16QAM	18900	1	0	Low	0.009	0.15	-63.98	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	16QAM	18900	1	0	Low	0.15	30	-65.22	PASS
Band2	3MHz	16QAM	18900	1	0	Low	30	1000	-49.37	PASS
Band2	3MHz	16QAM	18900	1	0	Low	1000	20000	-41.15	PASS
Band2	3MHz	QPSK	19185	1	5	High	0.009	0.15	-61.82	PASS
Band2	3MHz	QPSK	19185	1	5	High	0.15	30	-66.1	PASS
Band2	3MHz	QPSK	19185	1	5	High	30	1000	-50.77	PASS
Band2	3MHz	QPSK	19185	1	5	High	1000	20000	-41.12	PASS
Band2	3MHz	16QAM	19185	1	5	High	0.009	0.15	-63.48	PASS
Band2	3MHz	16QAM	19185	1	5	High	0.15	30	-63.17	PASS
Band2	3MHz	16QAM	19185	1	5	High	30	1000	-50.71	PASS
Band2	3MHz	16QAM	19185	1	5	High	1000	20000	-39.6	PASS
Band2	5MHz	QPSK	18625	1	0	Low	0.009	0.15	-64.17	PASS
Band2	5MHz	QPSK	18625	1	0	Low	0.15	30	-64.4	PASS
Band2	5MHz	QPSK	18625	1	0	Low	30	1000	-50.77	PASS
Band2	5MHz	QPSK	18625	1	0	Low	1000	20000	-41.26	PASS
Band2	5MHz	16QAM	18625	1	0	Low	0.009	0.15	-61.93	PASS
Band2	5MHz	16QAM	18625	1	0	Low	0.15	30	-60.95	PASS
Band2	5MHz	16QAM	18625	1	0	Low	30	1000	-50.76	PASS
Band2	5MHz	16QAM	18625	1	0	Low	1000	20000	-41.02	PASS
Band2	5MHz	QPSK	18900	1	0	Low	0.009	0.15	-62.12	PASS
Band2	5MHz	QPSK	18900	1	0	Low	0.15	30	-64.88	PASS
Band2	5MHz	QPSK	18900	1	0	Low	30	1000	-50.86	PASS
Band2	5MHz	QPSK	18900	1	0	Low	1000	20000	-41.09	PASS
Band2	5MHz	16QAM	18900	1	0	Low	0.009	0.15	-61.06	PASS
Band2	5MHz	16QAM	18900	1	0	Low	0.15	30	-65.54	PASS
Band2	5MHz	16QAM	18900	1	0	Low	30	1000	-50.83	PASS
Band2	5MHz	16QAM	18900	1	0	Low	1000	20000	-41.1	PASS
Band2	5MHz	QPSK	19175	1	5	High	0.009	0.15	-61.3	PASS
Band2	5MHz	QPSK	19175	1	5	High	0.15	30	-59.62	PASS
Band2	5MHz	QPSK	19175	1	5	High	30	1000	-50.87	PASS
Band2	5MHz	QPSK	19175	1	5	High	1000	20000	-41.11	PASS
Band2	5MHz	16QAM	19175	1	5	High	0.009	0.15	-60.53	PASS
Band2	5MHz	16QAM	19175	1	5	High	0.15	30	-61.64	PASS
Band2	5MHz	16QAM	19175	1	5	High	30	1000	-50.82	PASS
Band2	5MHz	16QAM	19175	1	5	High	1000	20000	-40.86	PASS
Band2	10MHz	QPSK	18650	1	0	Low	0.009	0.15	-63.41	PASS
Band2	10MHz	QPSK	18650	1	0	Low	0.15	30	-62.67	PASS
Band2	10MHz	QPSK	18650	1	0	Low	30	1000	-50.76	PASS
Band2	10MHz	QPSK	18650	1	0	Low	1000	20000	-38.76	PASS
Band2	10MHz	16QAM	18650	1	0	Low	0.009	0.15	-61.54	PASS
Band2	10MHz	16QAM	18650	1	0	Low	0.15	30	-65.1	PASS
Band2	10MHz	16QAM	18650	1	0	Low	30	1000	-50.68	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com