

Appendix Test Data

Report No.:	1812C50391512504	Test Sample No.:	1-2-2
Start Test Date:	2025-8-7	Finish Test Date:	2025-8-15
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	25.9℃	Relative Humidity:	58%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.64	5171.24	5188.88	---	---
11A	Ant1	5200	17.52	5191.28	5208.80	---	---
11A	Ant1	5240	17.76	5231.08	5248.84	---	---
11A	Ant1	5260	17.76	5251.12	5268.88	---	---
11A	Ant1	5280	17.84	5271.12	5288.96	---	---
11A	Ant1	5320	17.76	5311.16	5328.92	---	---
11A	Ant1	5500	17.68	5491.20	5508.88	---	---
11A	Ant1	5580	17.64	5571.20	5588.84	---	---
11A	Ant1	5700	17.72	5691.20	5708.92	---	---
11A	Ant1	5745	17.60	5736.20	5753.80	---	---
11A	Ant1	5785	17.68	5776.12	5793.80	---	---
11A	Ant1	5825	17.64	5816.20	5833.84	---	---
11N20SISO	Ant1	5180	18.44	5170.80	5189.24	---	---
11N20SISO	Ant1	5200	18.40	5190.84	5209.24	---	---
11N20SISO	Ant1	5240	18.44	5230.80	5249.24	---	---
11N20SISO	Ant1	5260	18.44	5250.80	5269.24	---	---
11N20SISO	Ant1	5280	18.44	5270.80	5289.24	---	---
11N20SISO	Ant1	5320	18.44	5310.80	5329.24	---	---
11N20SISO	Ant1	5500	18.48	5490.80	5509.28	---	---
11N20SISO	Ant1	5580	18.40	5570.80	5589.20	---	---
11N20SISO	Ant1	5700	18.44	5690.80	5709.24	---	---
11N20SISO	Ant1	5745	18.44	5735.80	5754.24	---	---
11N20SISO	Ant1	5785	18.36	5775.84	5794.20	---	---
11N20SISO	Ant1	5825	18.44	5815.80	5834.24	---	---
11N40SISO	Ant1	5190	38.24	5170.80	5209.04	---	---

11N40SISO	Ant1	5230	38.00	5210.88	5248.88	---	---
11N40SISO	Ant1	5270	38.32	5250.80	5289.12	---	---
11N40SISO	Ant1	5310	38.08	5290.80	5328.88	---	---
11N40SISO	Ant1	5510	38.16	5490.80	5528.96	---	---
11N40SISO	Ant1	5550	38.32	5530.80	5569.12	---	---
11N40SISO	Ant1	5670	38.00	5650.80	5688.80	---	---
11N40SISO	Ant1	5755	38.32	5735.72	5774.04	---	---
11N40SISO	Ant1	5795	38.32	5775.80	5814.12	---	---
11AC20SISO	Ant1	5180	18.84	5170.56	5189.40	---	---
11AC20SISO	Ant1	5200	18.76	5190.56	5209.32	---	---
11AC20SISO	Ant1	5240	18.68	5230.64	5249.32	---	---
11AC20SISO	Ant1	5260	18.76	5250.56	5269.32	---	---
11AC20SISO	Ant1	5280	18.68	5270.68	5289.36	---	---
11AC20SISO	Ant1	5320	18.80	5310.60	5329.40	---	---
11AC20SISO	Ant1	5500	18.72	5490.64	5509.36	---	---
11AC20SISO	Ant1	5580	18.72	5570.60	5589.32	---	---
11AC20SISO	Ant1	5700	18.76	5690.60	5709.36	---	---
11AC20SISO	Ant1	5745	18.76	5735.60	5754.36	---	---
11AC20SISO	Ant1	5785	18.72	5775.64	5794.36	---	---
11AC20SISO	Ant1	5825	18.64	5815.64	5834.28	---	---
11AC40SISO	Ant1	5190	38.72	5170.72	5209.44	---	---
11AC40SISO	Ant1	5230	38.08	5210.80	5248.88	---	---
11AC40SISO	Ant1	5270	38.32	5250.80	5289.12	---	---
11AC40SISO	Ant1	5310	38.72	5290.72	5329.44	---	---
11AC40SISO	Ant1	5510	38.08	5490.80	5528.88	---	---
11AC40SISO	Ant1	5550	38.32	5530.80	5569.12	---	---
11AC40SISO	Ant1	5670	38.56	5650.88	5689.44	---	---
11AC40SISO	Ant1	5755	38.64	5735.72	5774.36	---	---
11AC40SISO	Ant1	5795	38.48	5775.80	5814.28	---	---
11AX20SISO	Ant1	5180	19.88	5170.04	5189.92	---	---
11AX20SISO	Ant1	5200	19.84	5190.16	5210.00	---	---
11AX20SISO	Ant1	5240	19.88	5230.12	5250.00	---	---
11AX20SISO	Ant1	5260	19.80	5250.16	5269.96	---	---
11AX20SISO	Ant1	5280	19.76	5270.08	5289.84	---	---
11AX20SISO	Ant1	5320	19.80	5310.08	5329.88	---	---
11AX20SISO	Ant1	5500	19.88	5490.04	5509.92	---	---
11AX20SISO	Ant1	5580	19.88	5570.08	5589.96	---	---
11AX20SISO	Ant1	5700	19.84	5690.08	5709.92	---	---
11AX20SISO	Ant1	5745	19.80	5735.04	5754.84	---	---
11AX20SISO	Ant1	5785	19.88	5775.08	5794.96	---	---
11AX20SISO	Ant1	5825	19.80	5815.08	5834.88	---	---
11AX40SISO	Ant1	5190	39.52	5170.24	5209.76	---	---


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX40SISO	Ant1	5230	39.28	5210.32	5249.60	---	---
11AX40SISO	Ant1	5270	39.36	5250.24	5289.60	---	---
11AX40SISO	Ant1	5310	39.36	5290.24	5329.60	---	---
11AX40SISO	Ant1	5510	39.68	5490.08	5529.76	---	---
11AX40SISO	Ant1	5550	39.44	5530.16	5569.60	---	---
11AX40SISO	Ant1	5670	39.28	5650.32	5689.60	---	---
11AX40SISO	Ant1	5755	39.44	5735.16	5774.60	---	---
11AX40SISO	Ant1	5795	39.44	5775.16	5814.60	---	---

Test Graphs

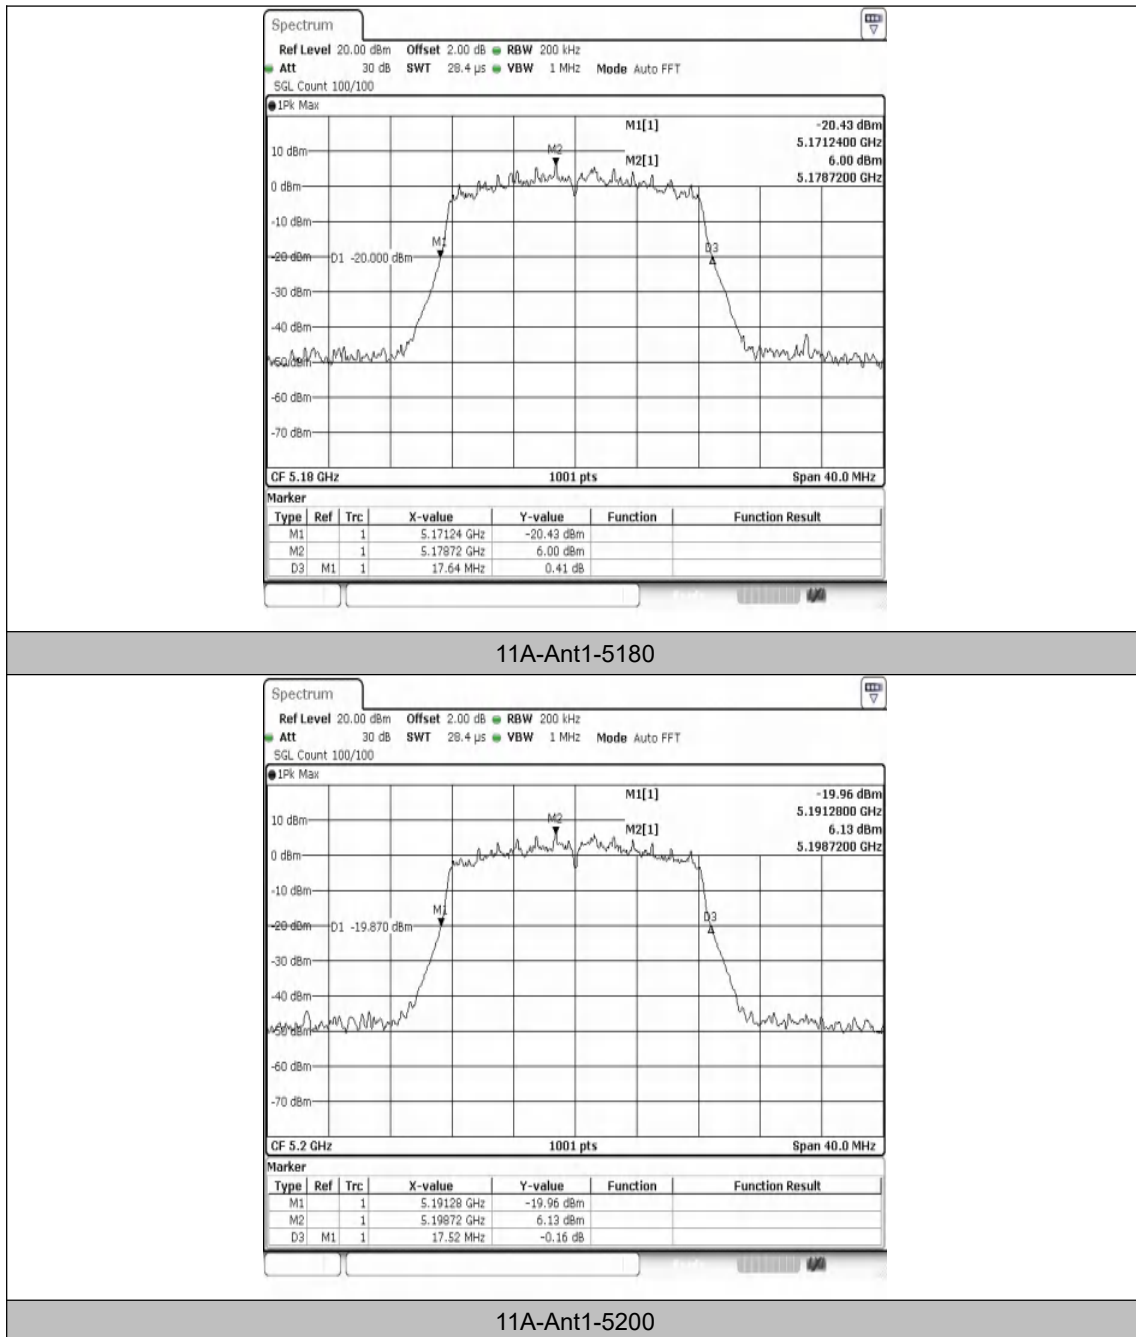


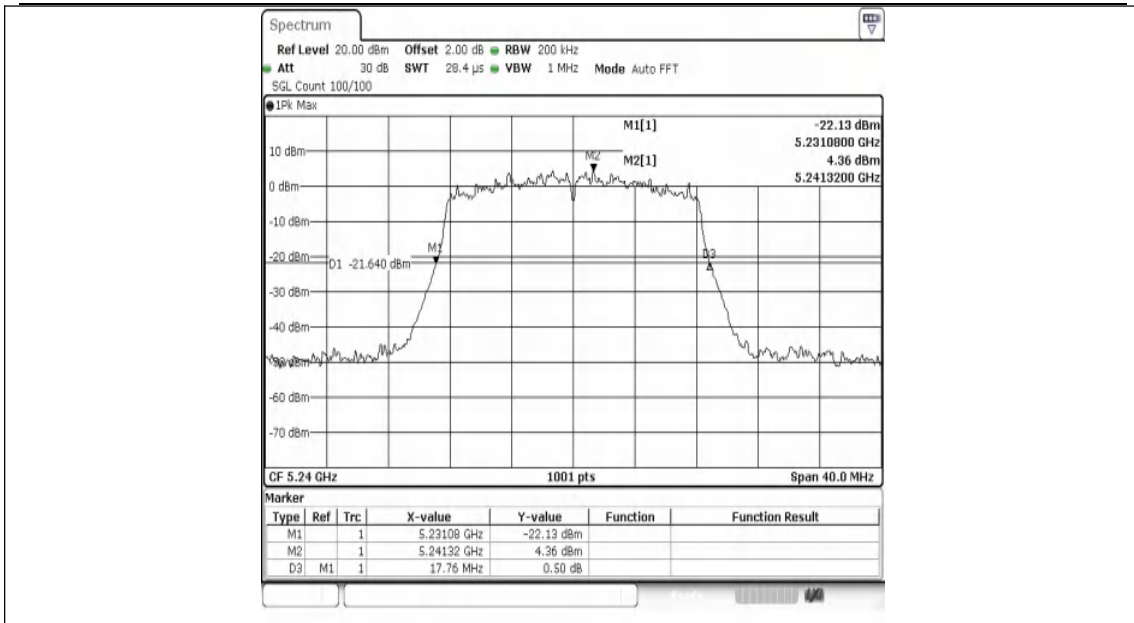


11A-Ant1-5240

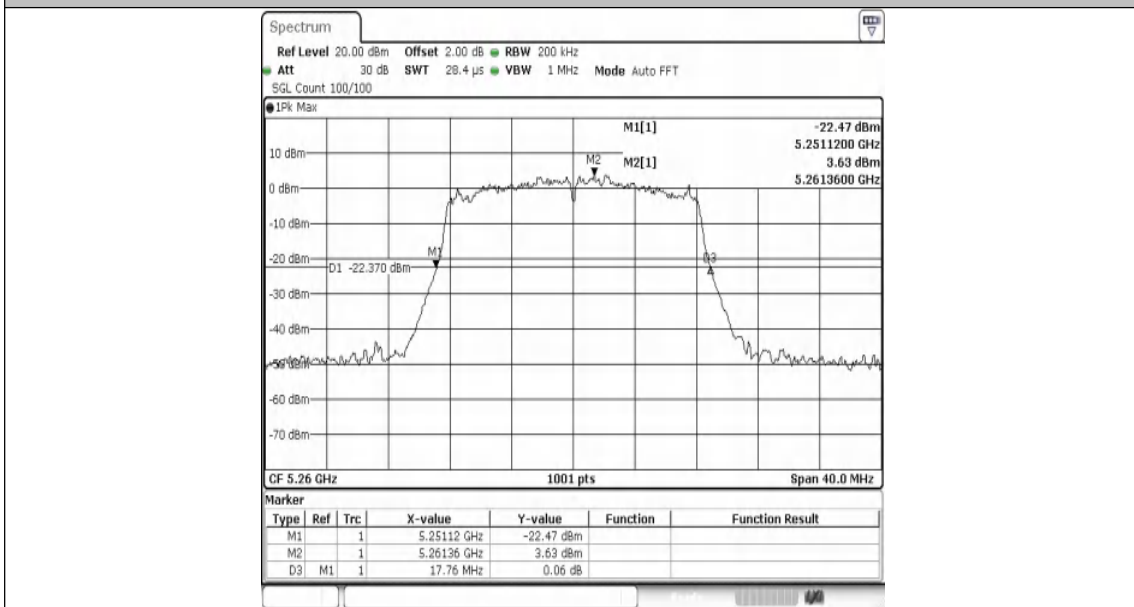


11A-Ant1-5260

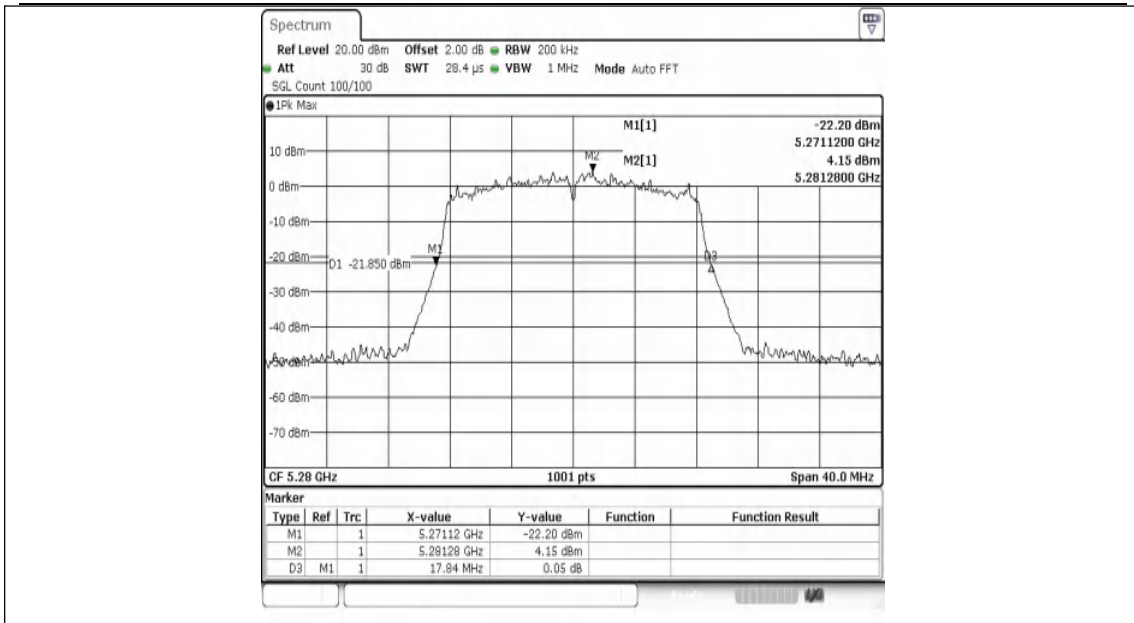


11A-Ant1-5280

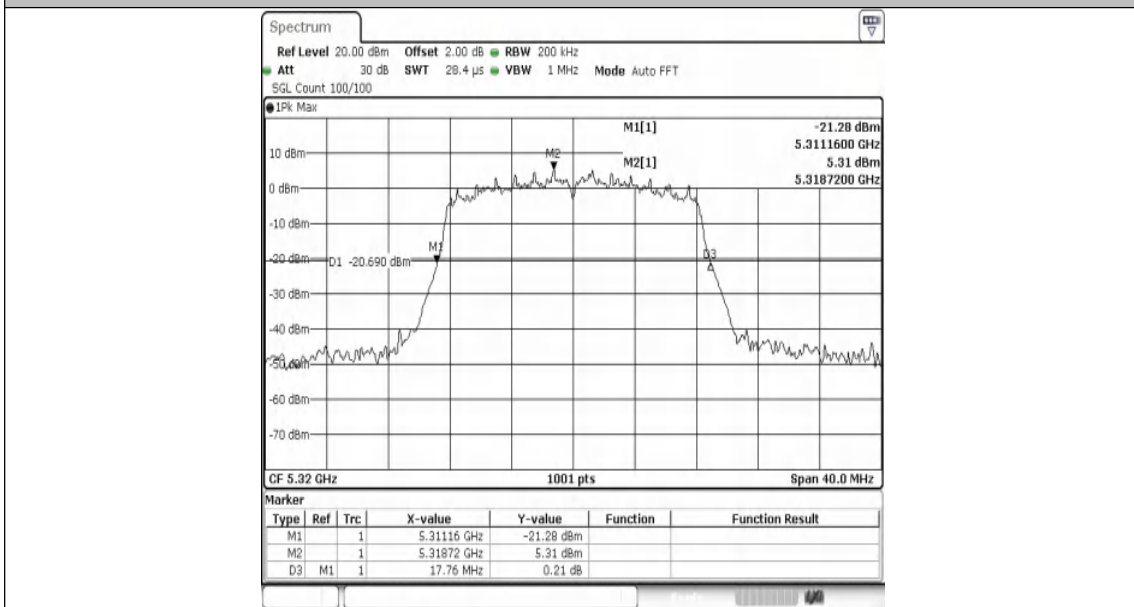


11A-Ant1-5320

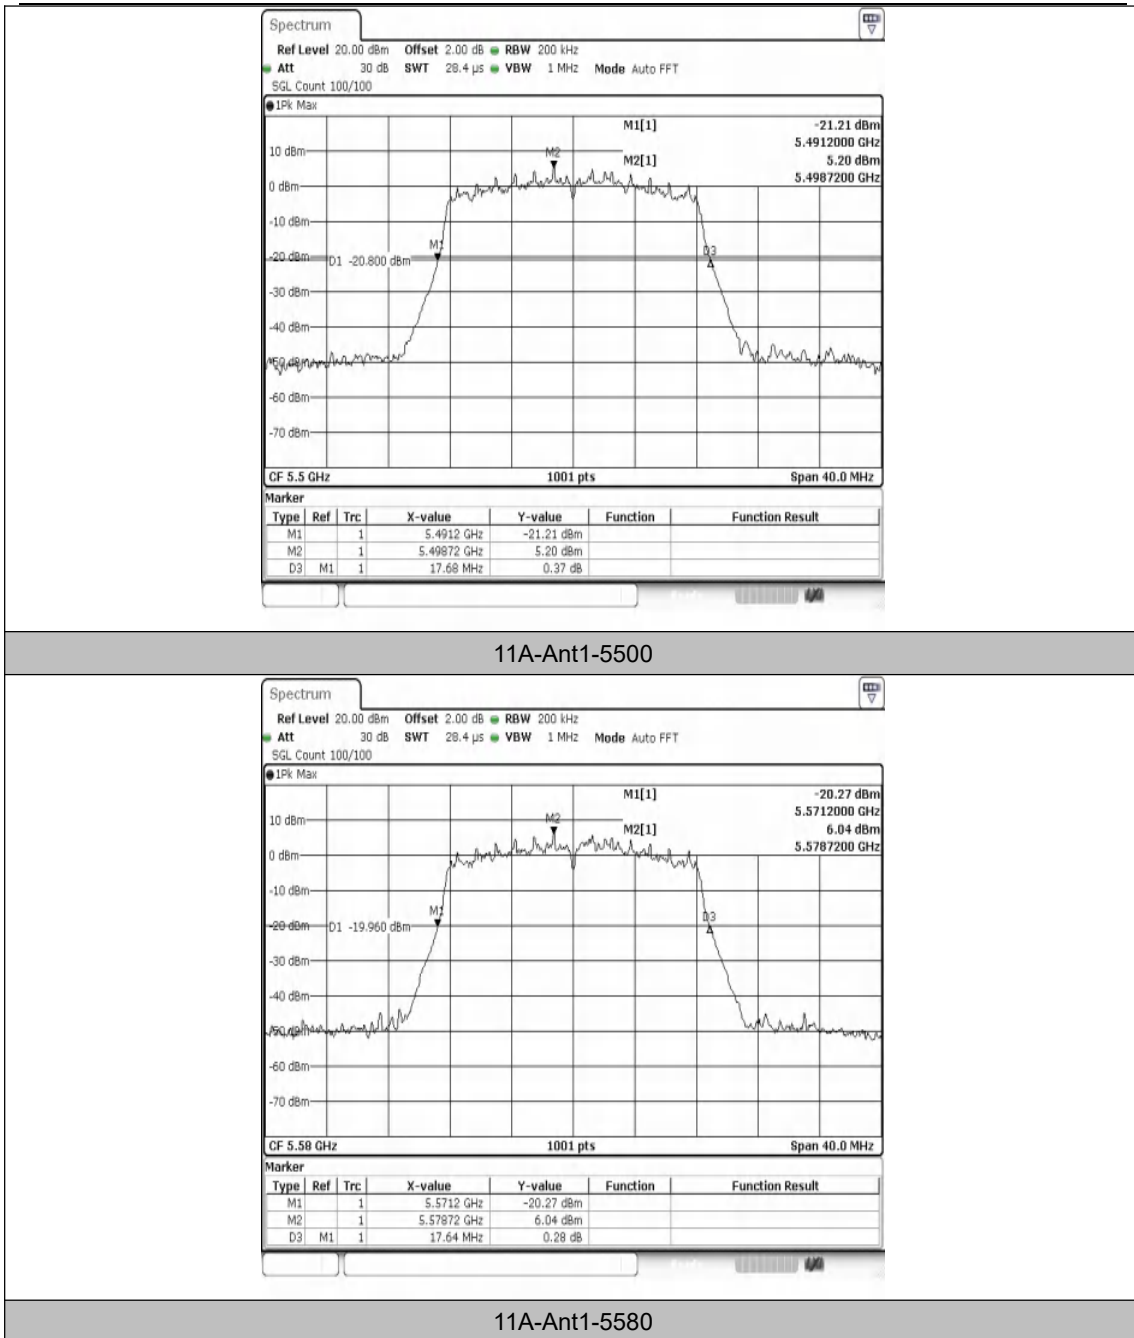


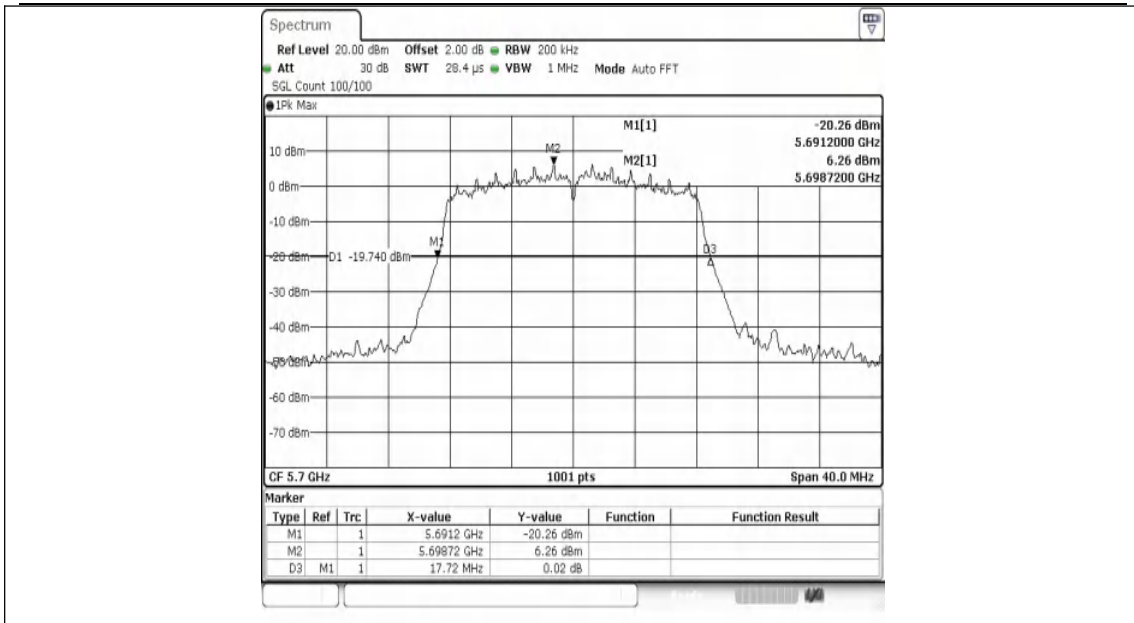


11A-Ant1-5700

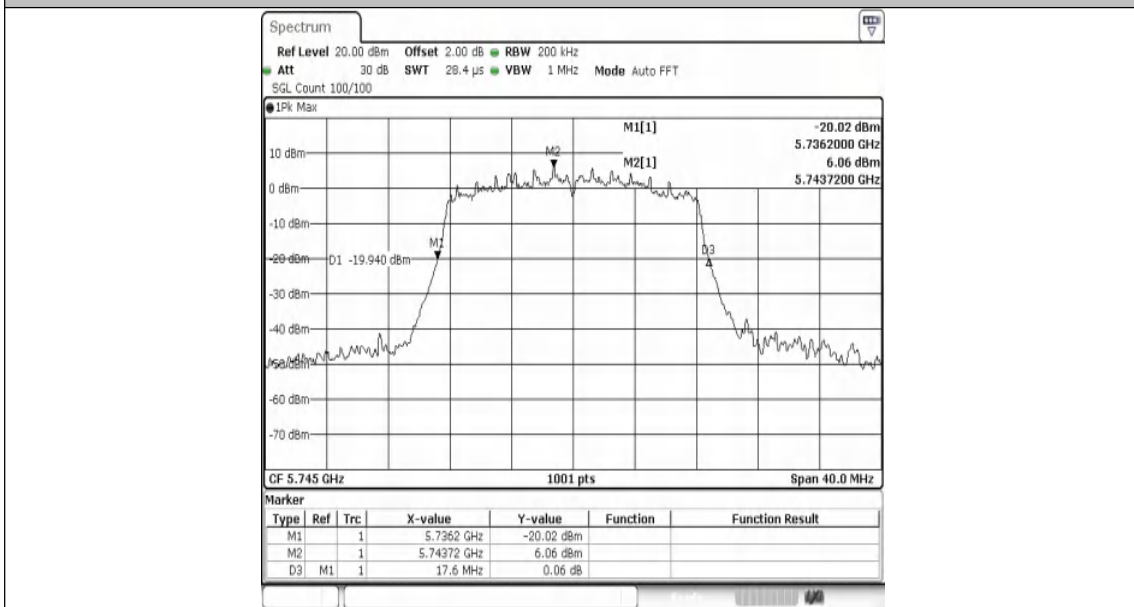


11A-Ant1-5745

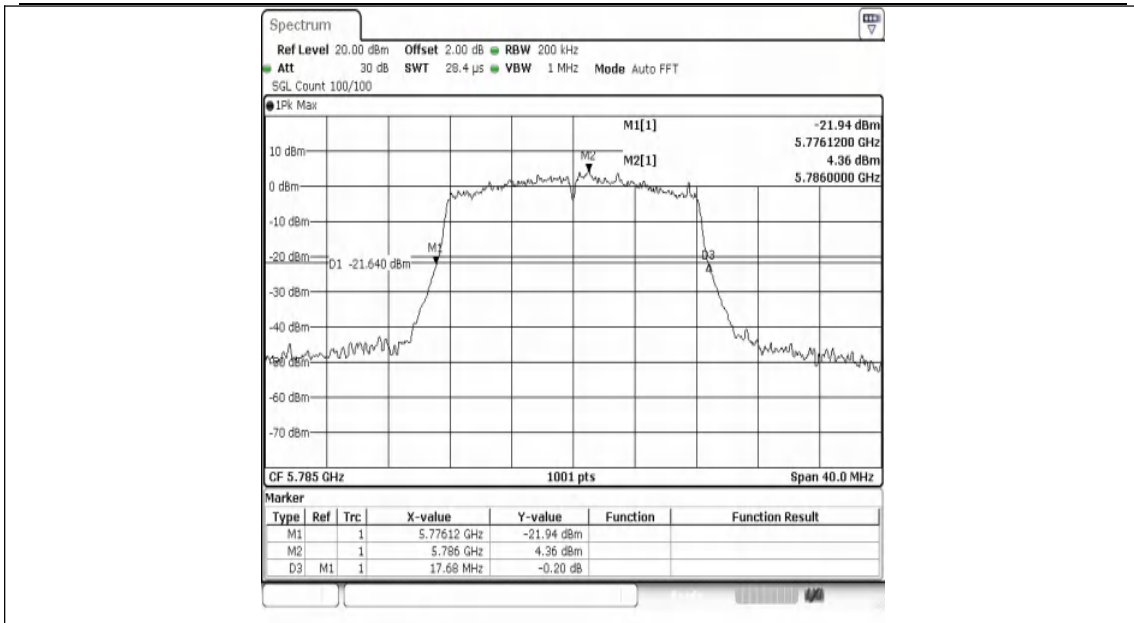



11A-Ant1-5785

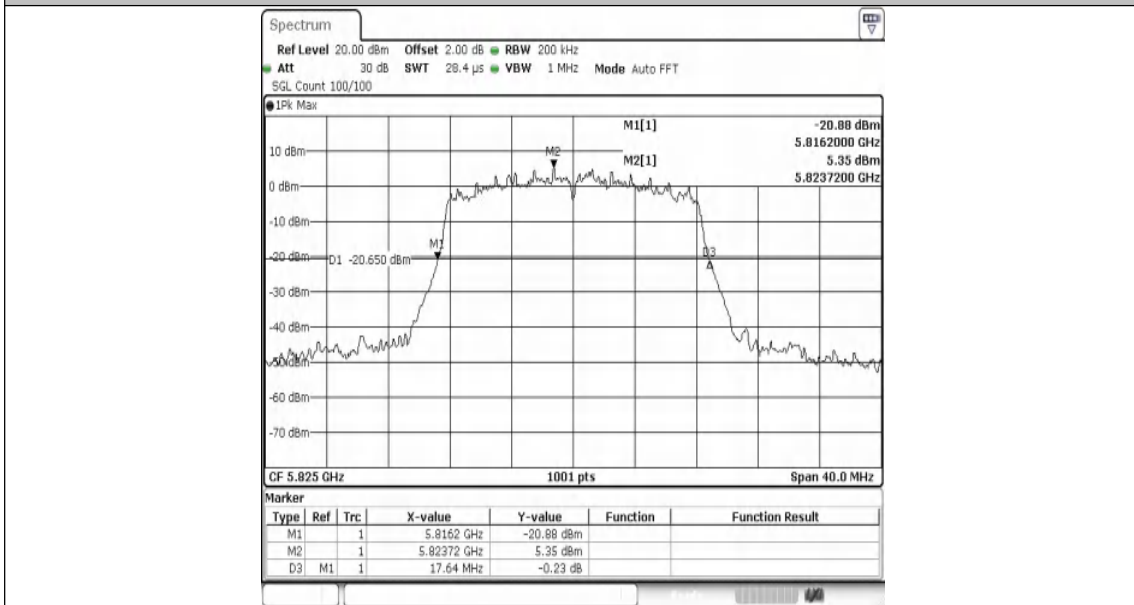


11A-Ant1-5825

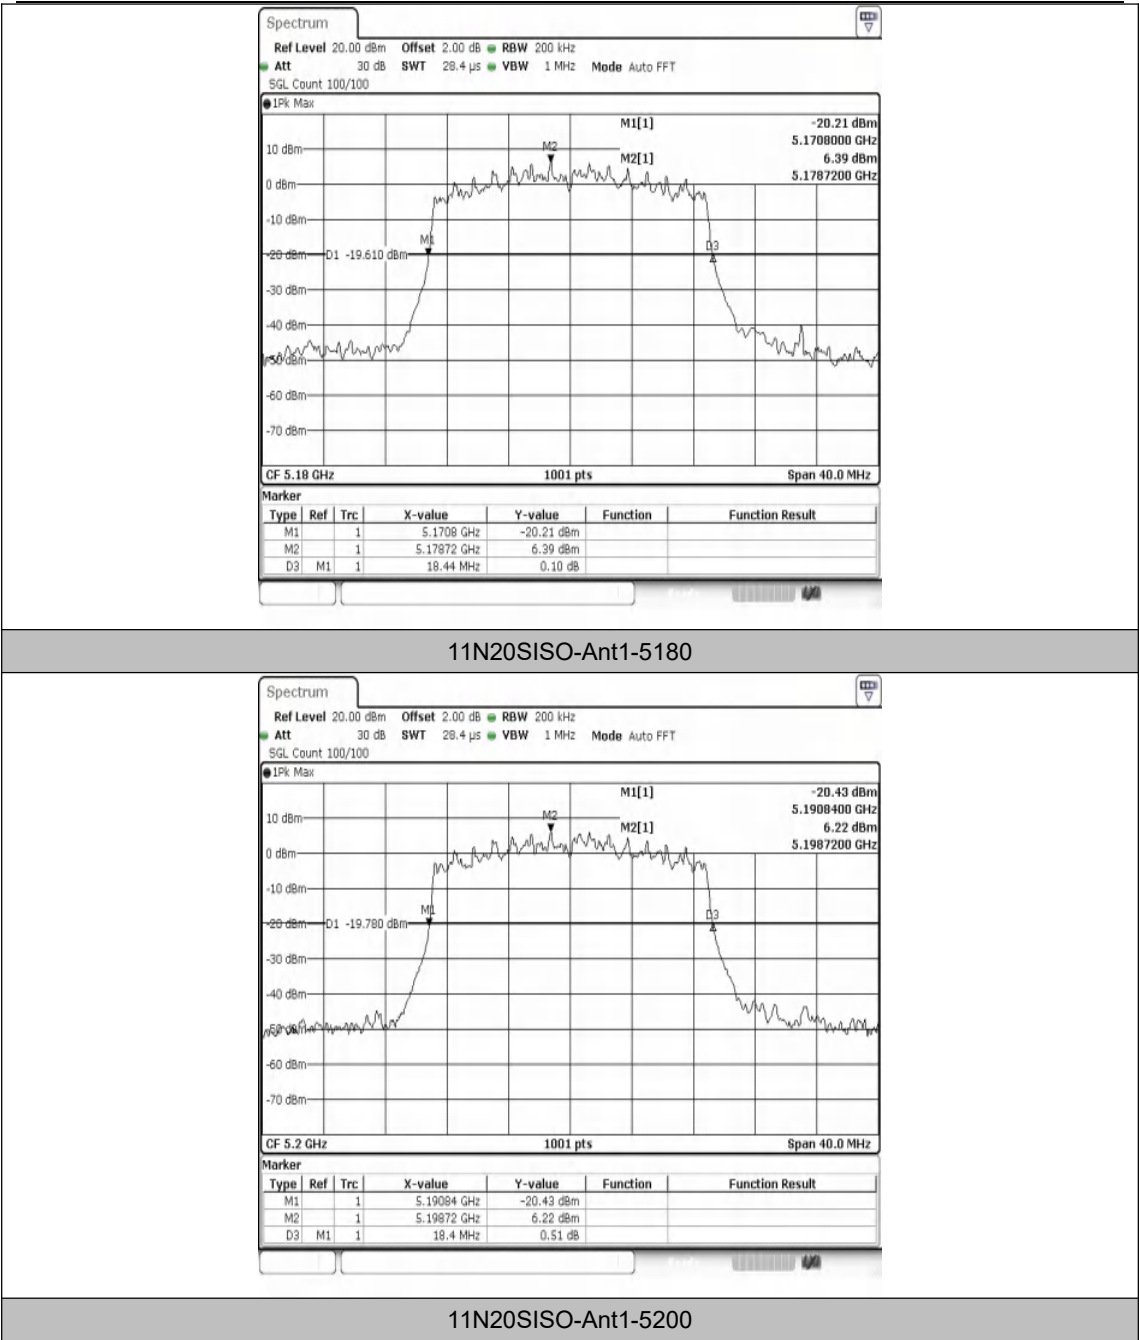

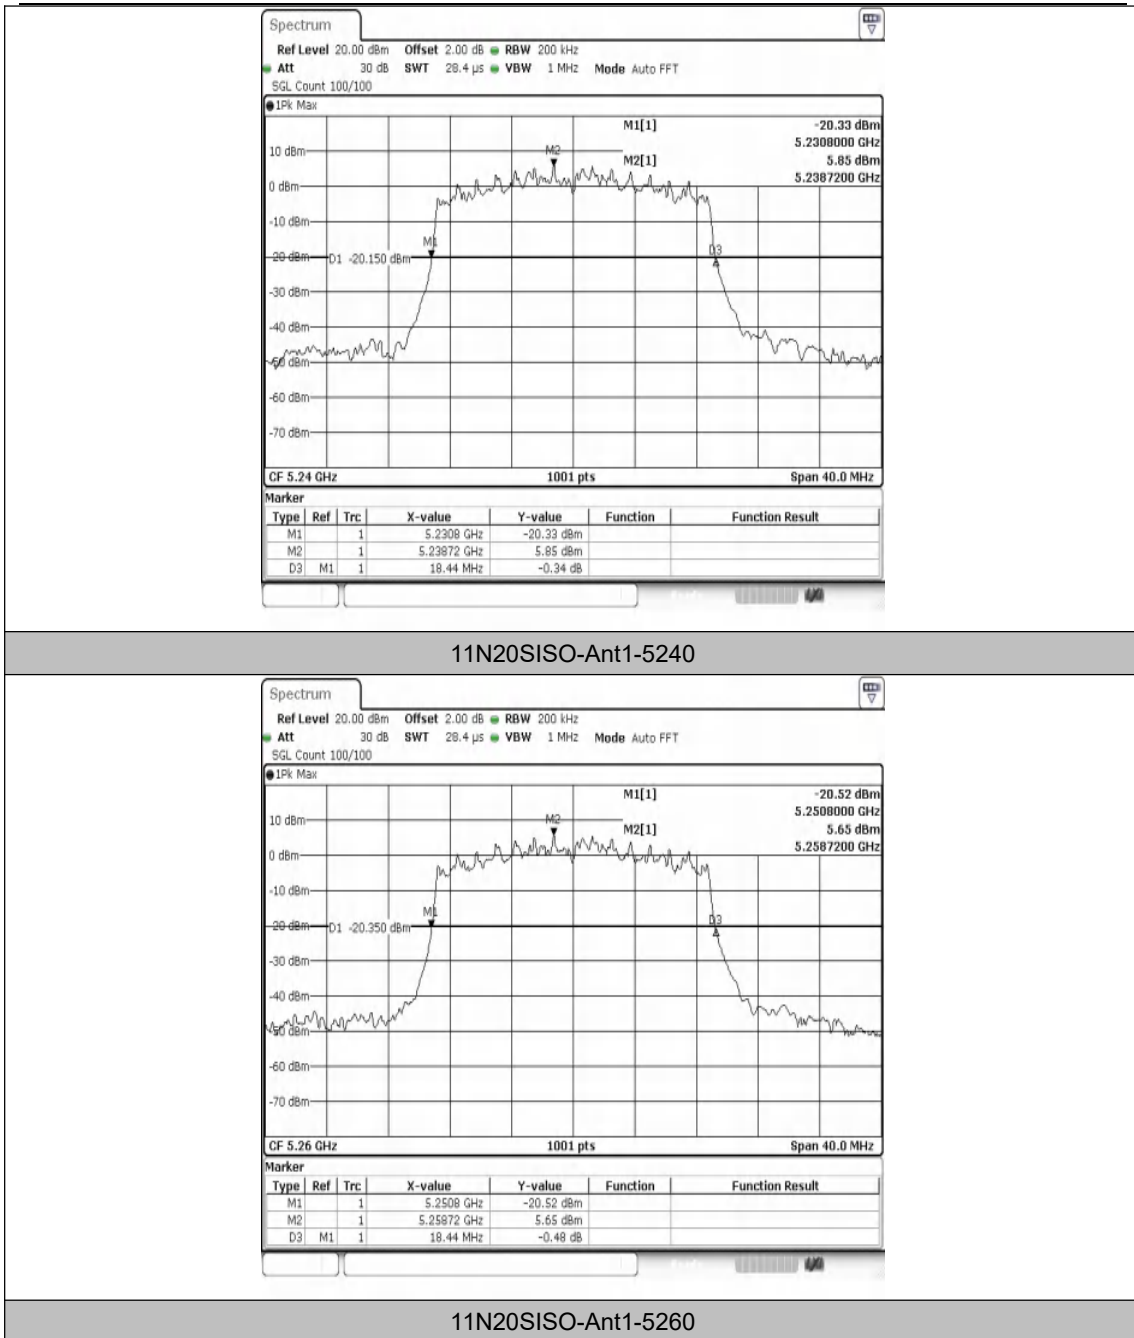

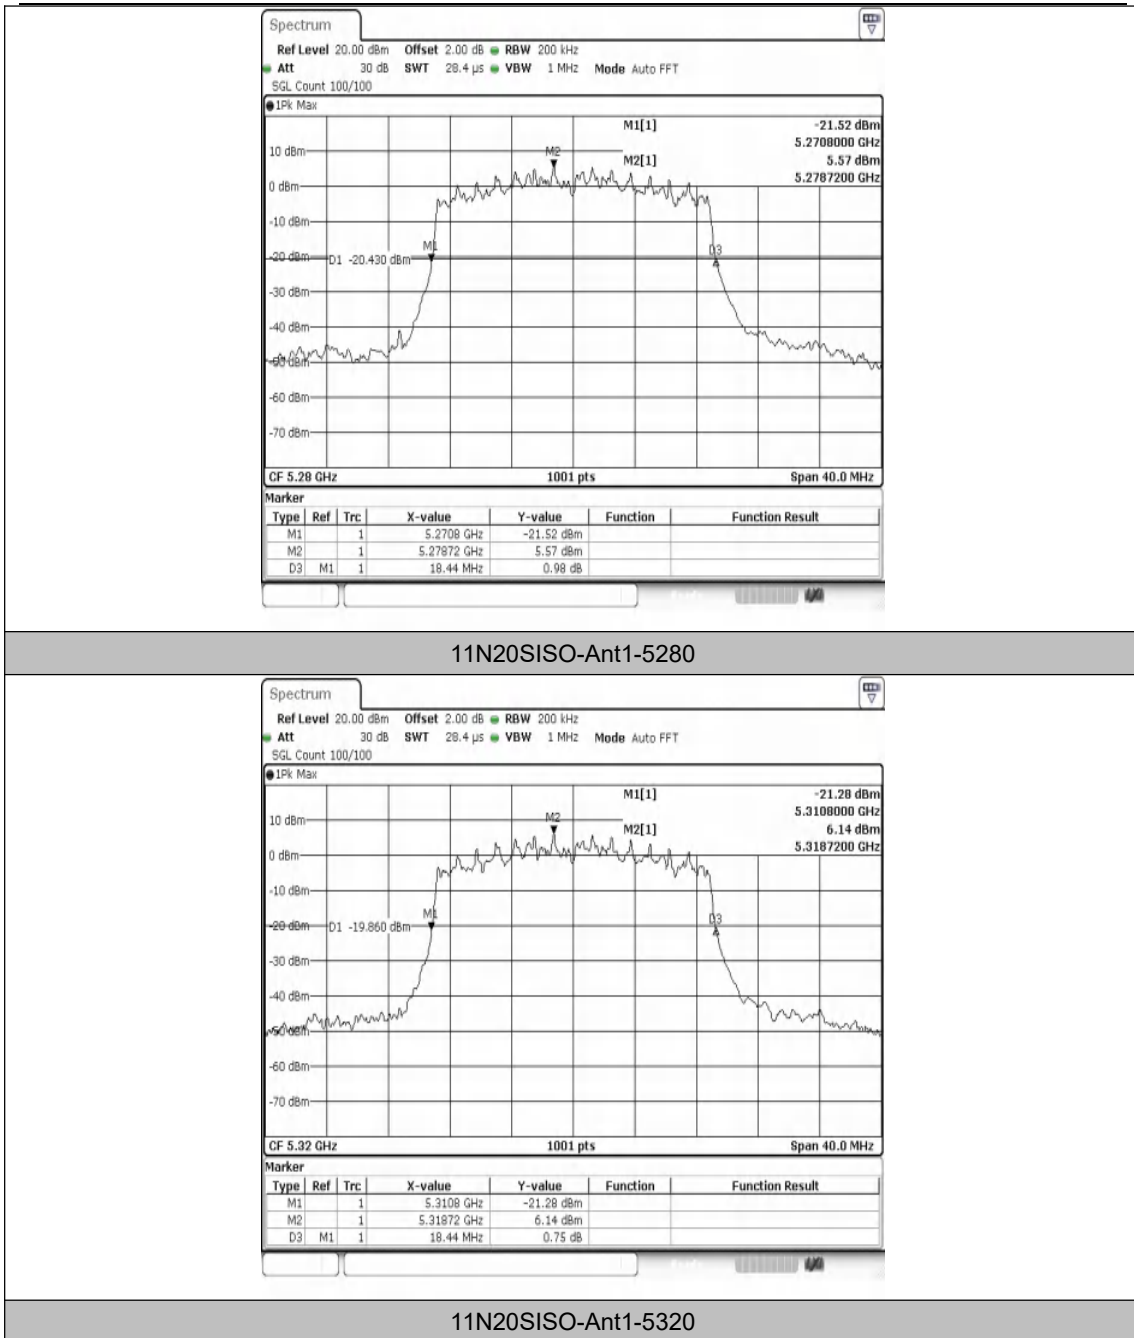


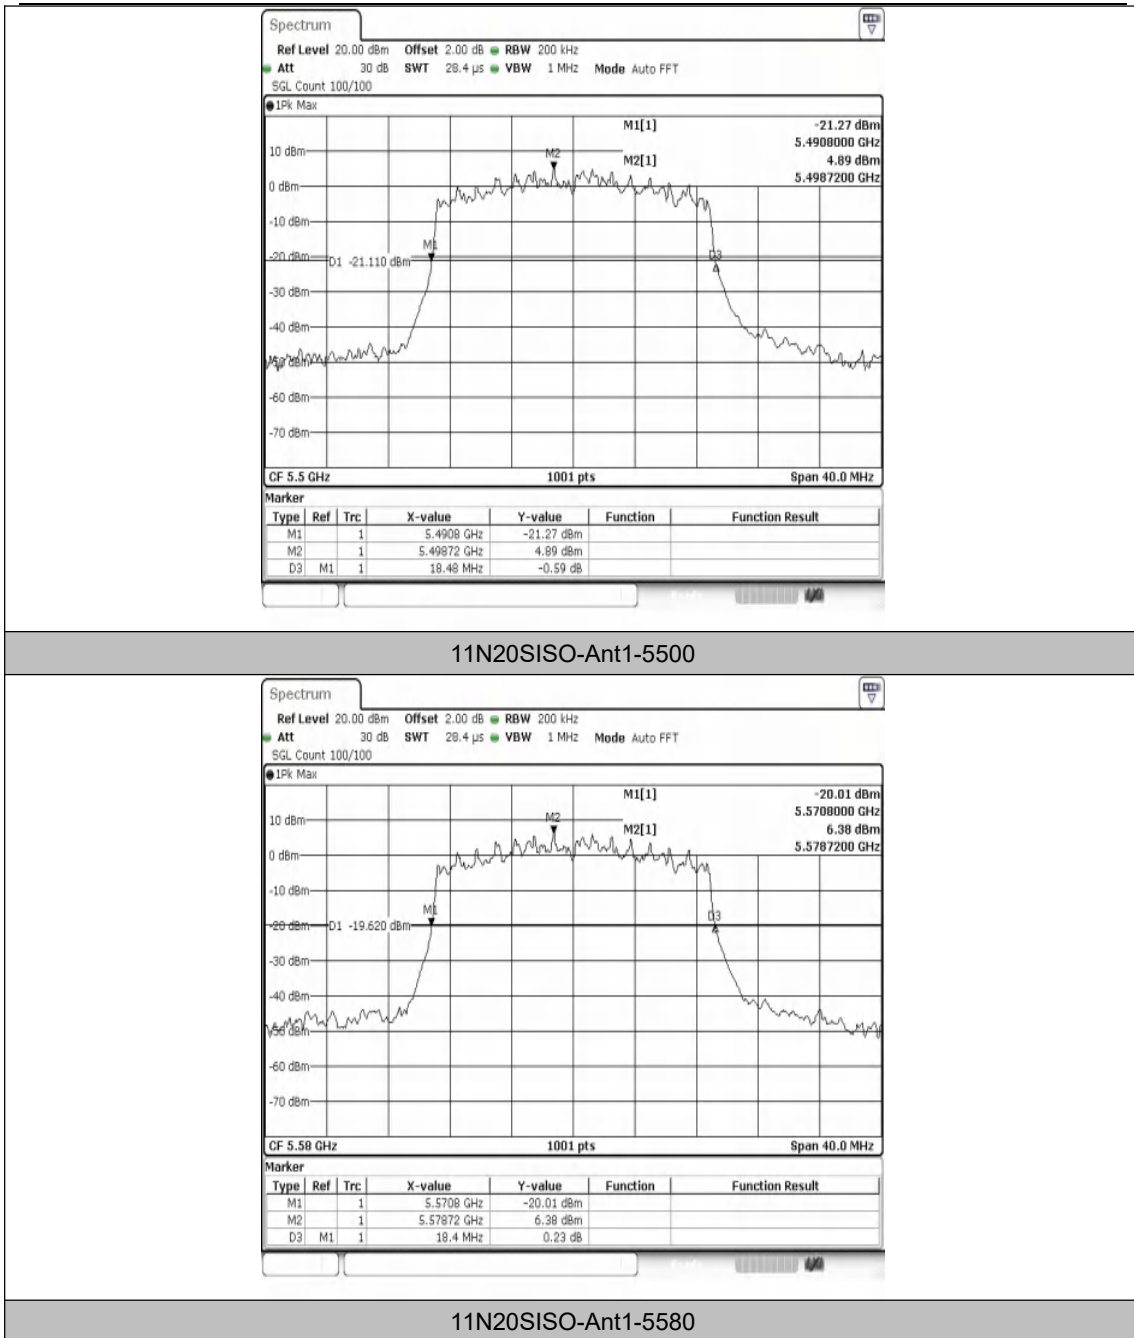

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

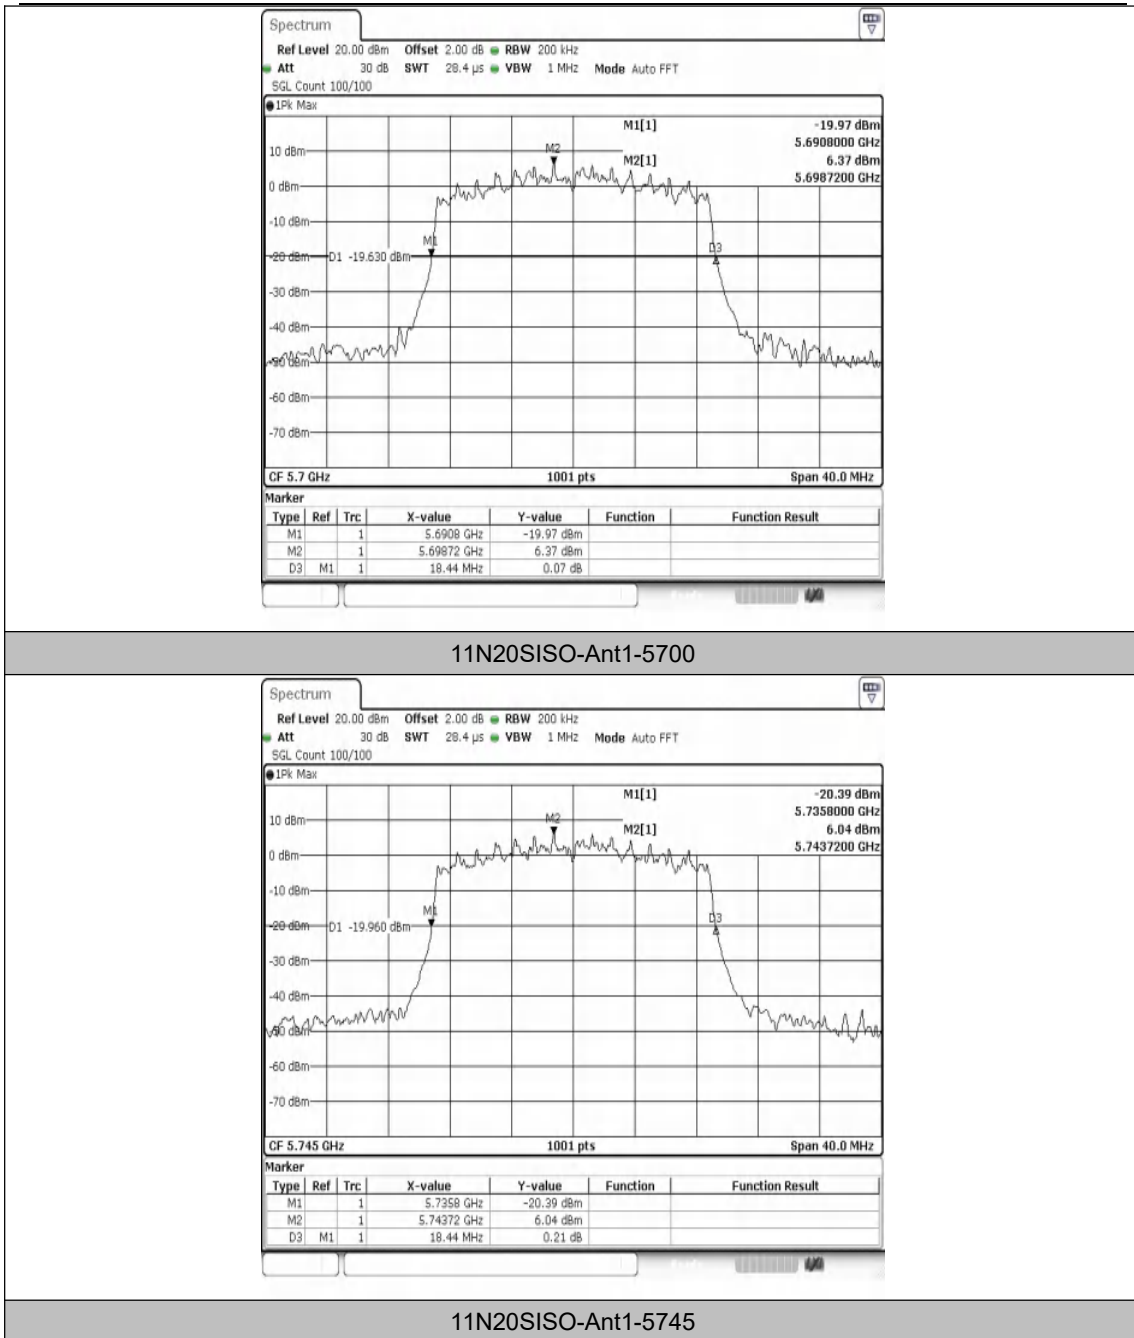



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

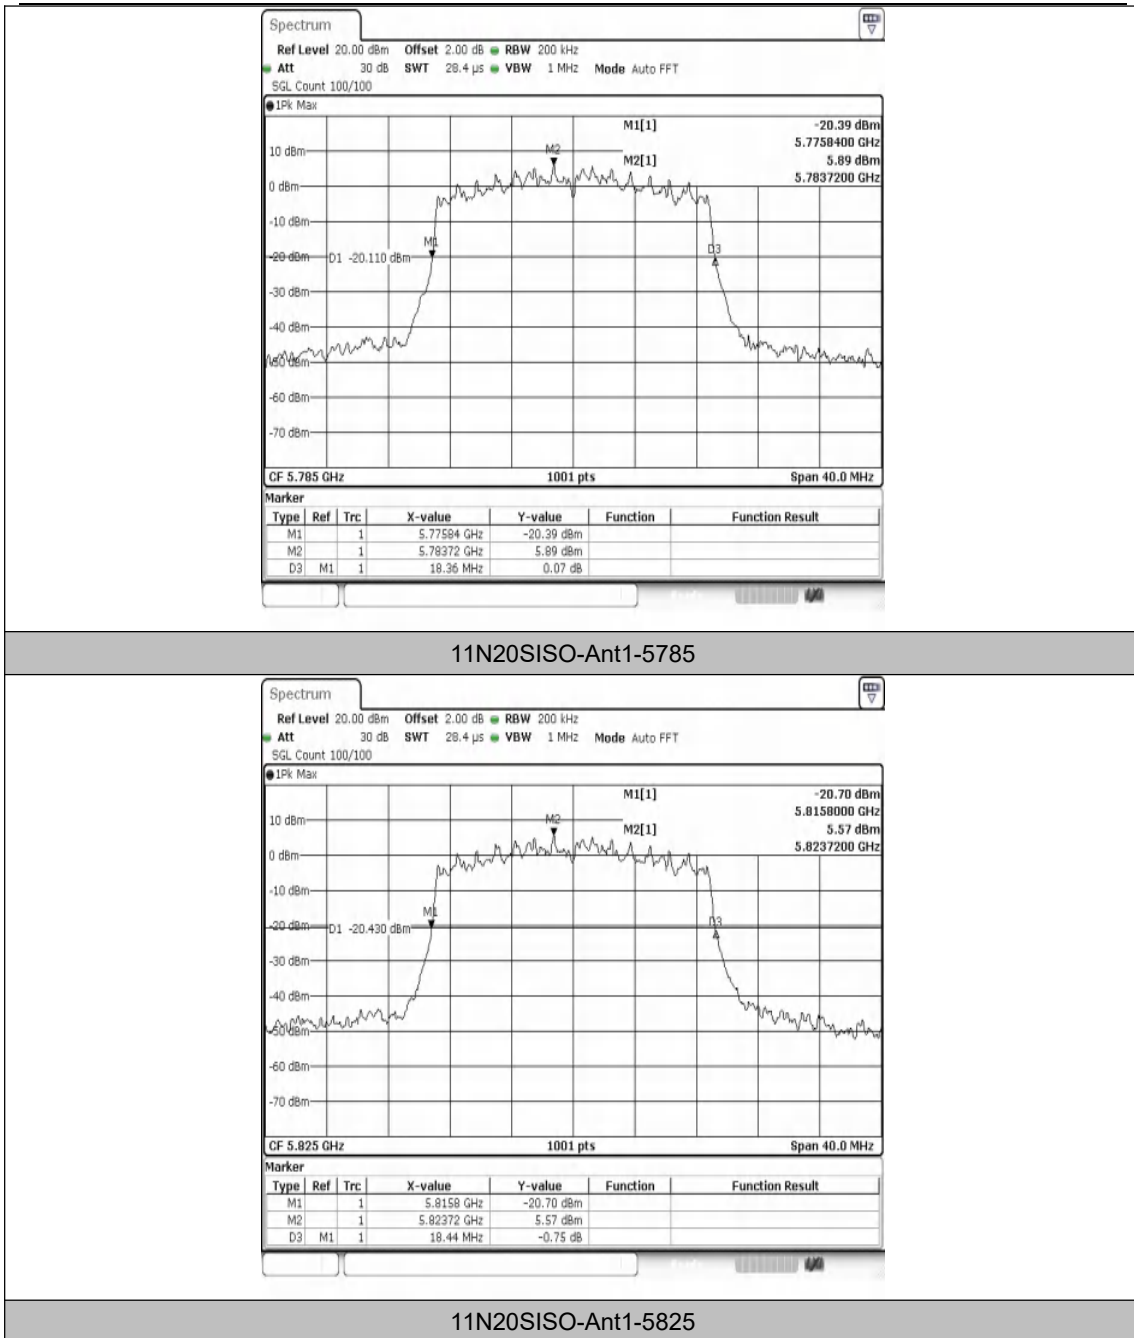


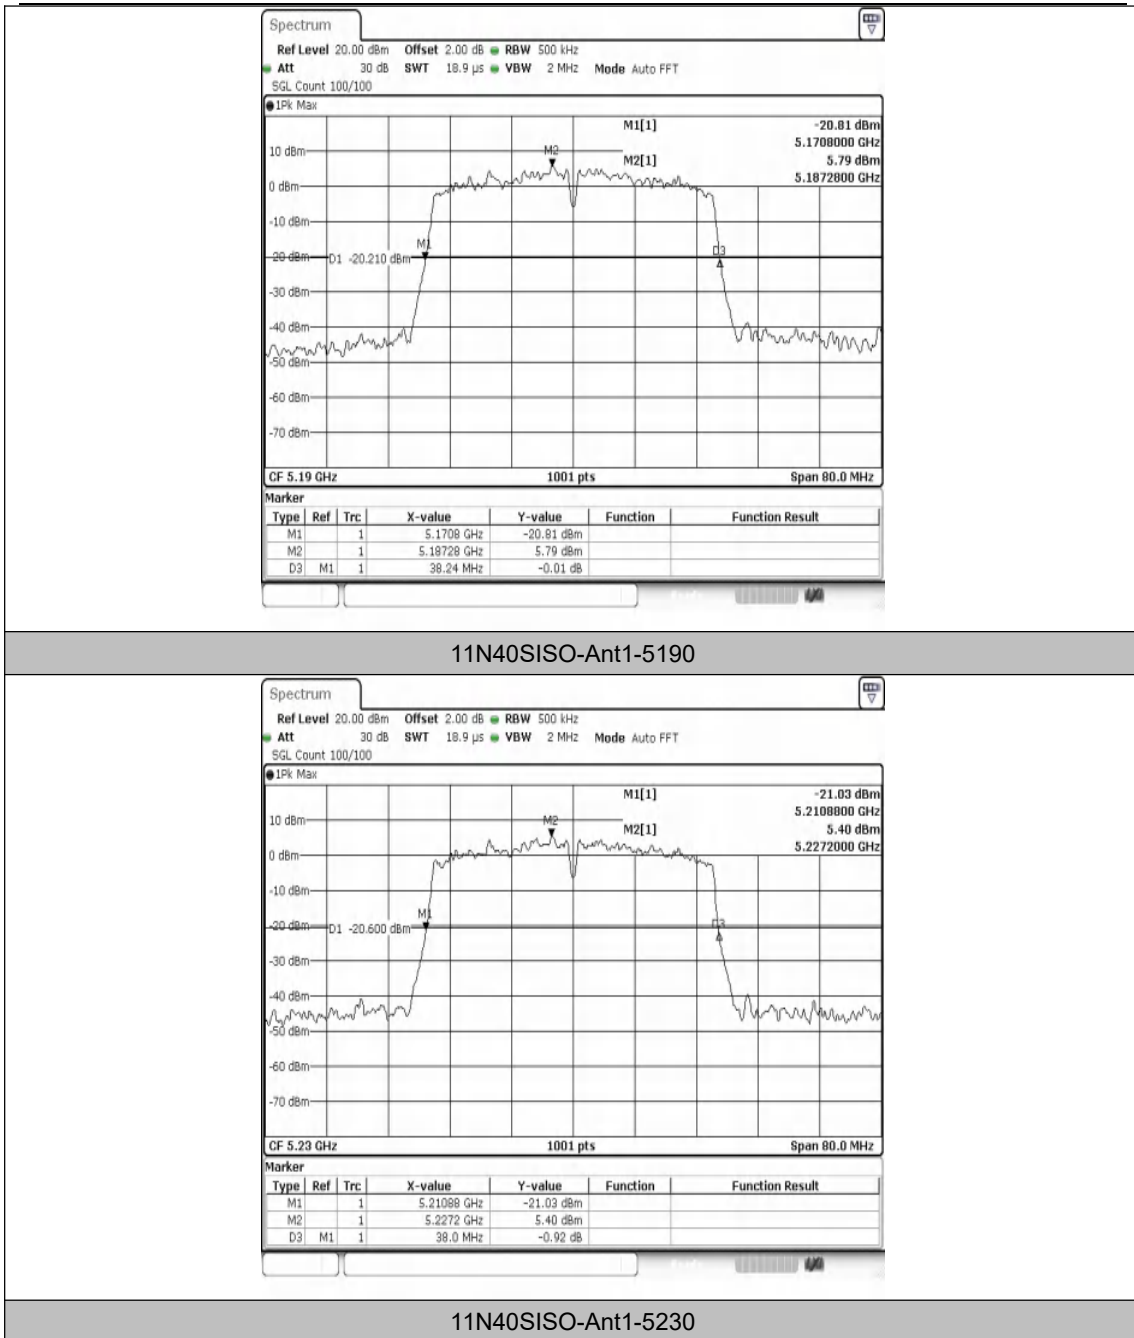

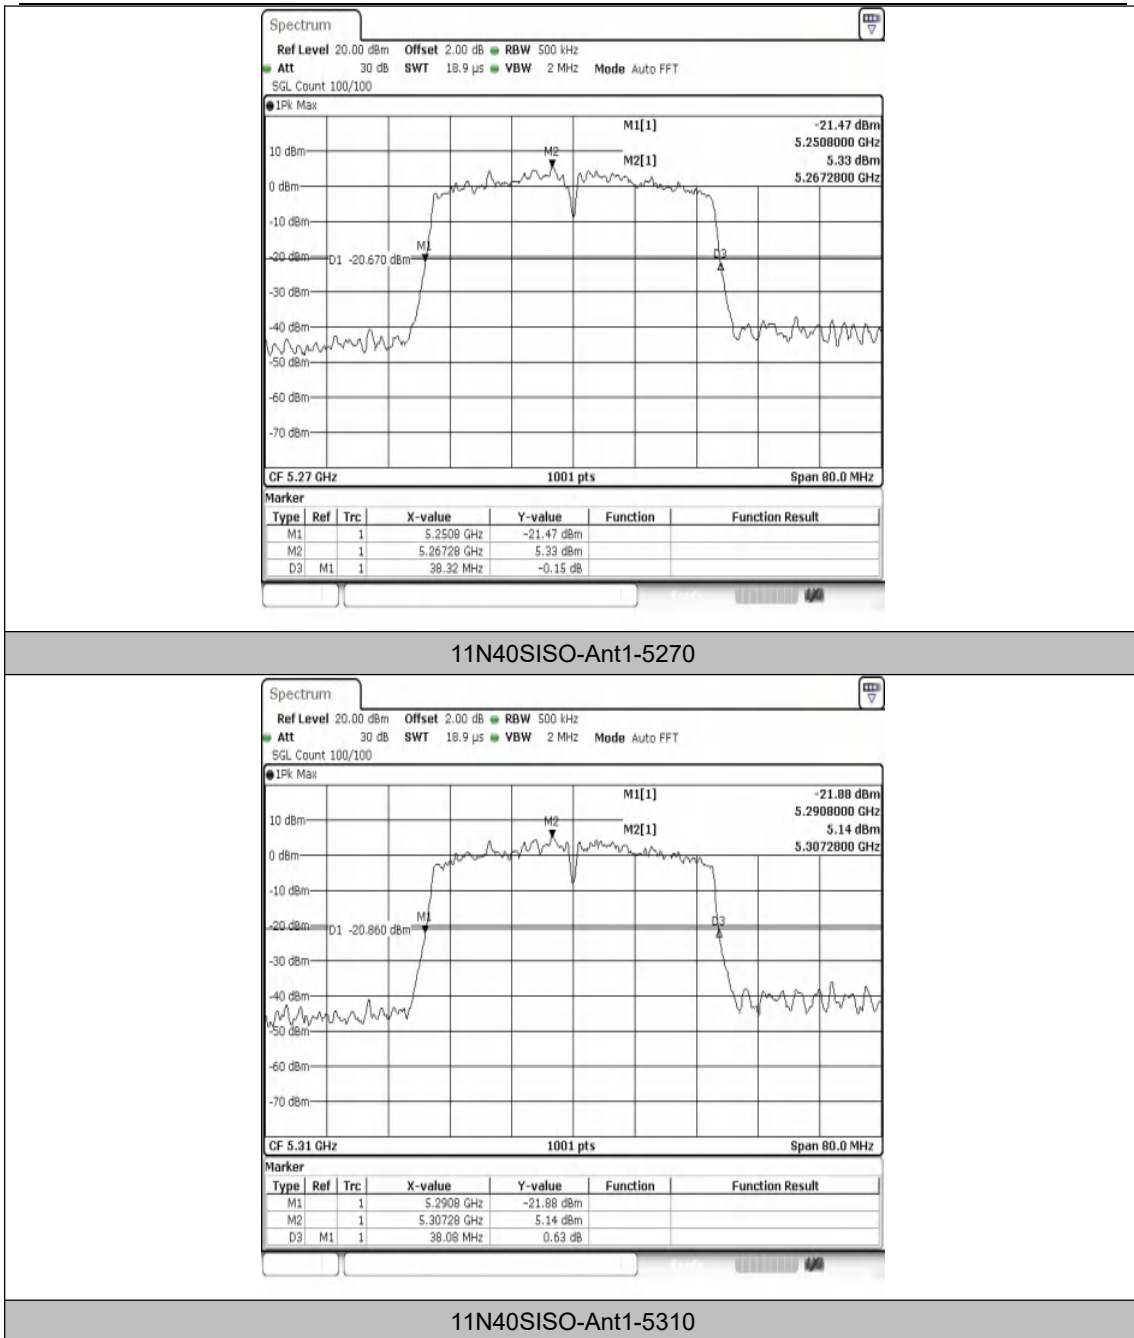


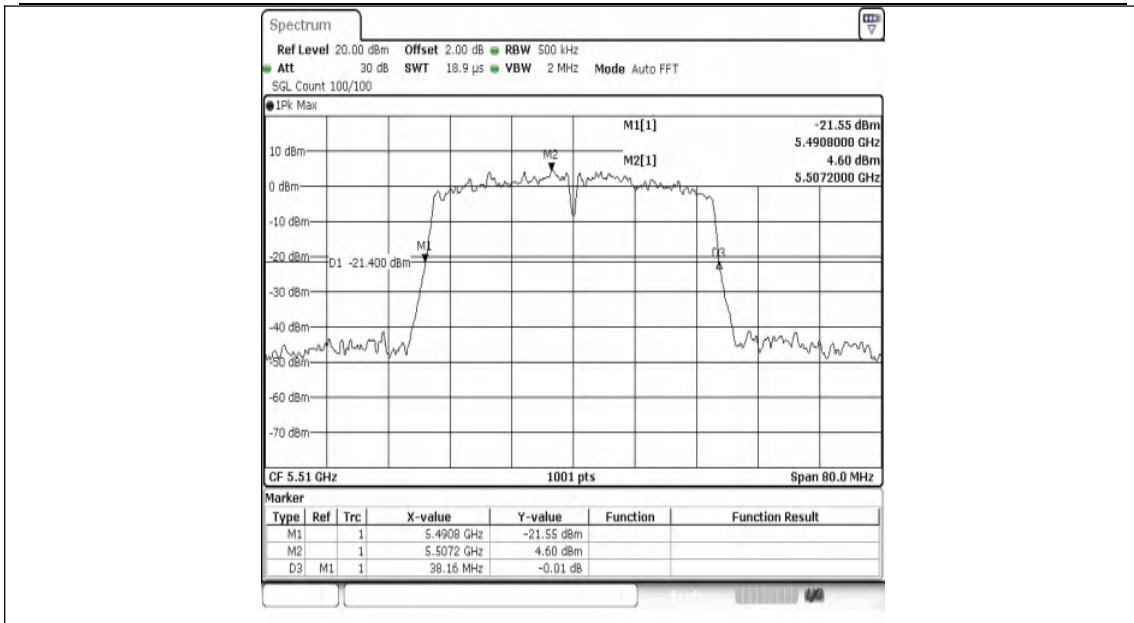


11N40SISO-Ant1-5510

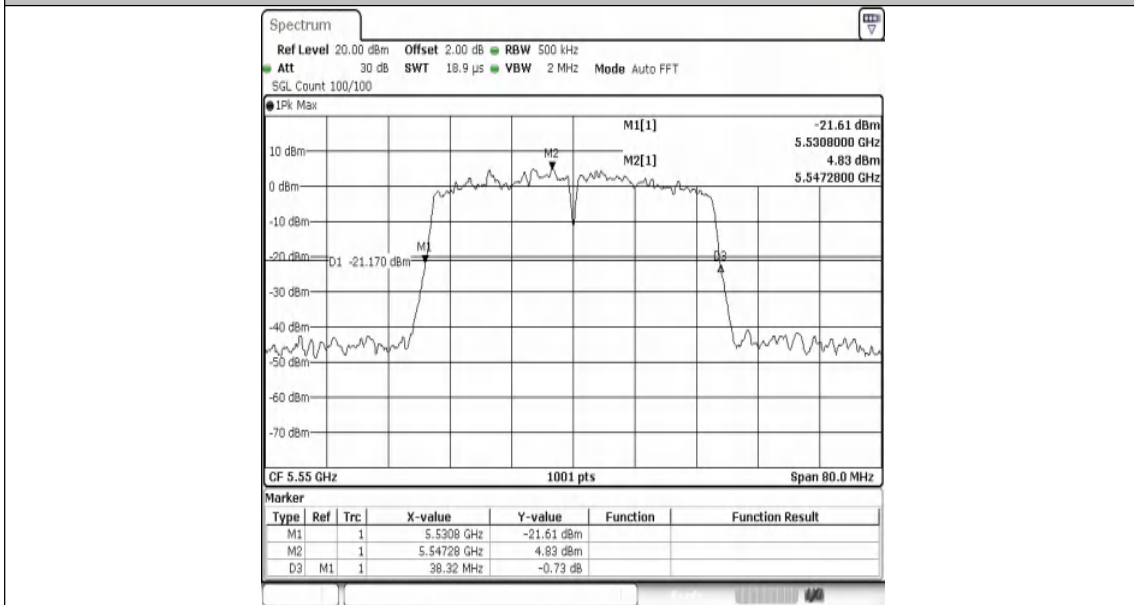

11N40SISO-Ant1-5550

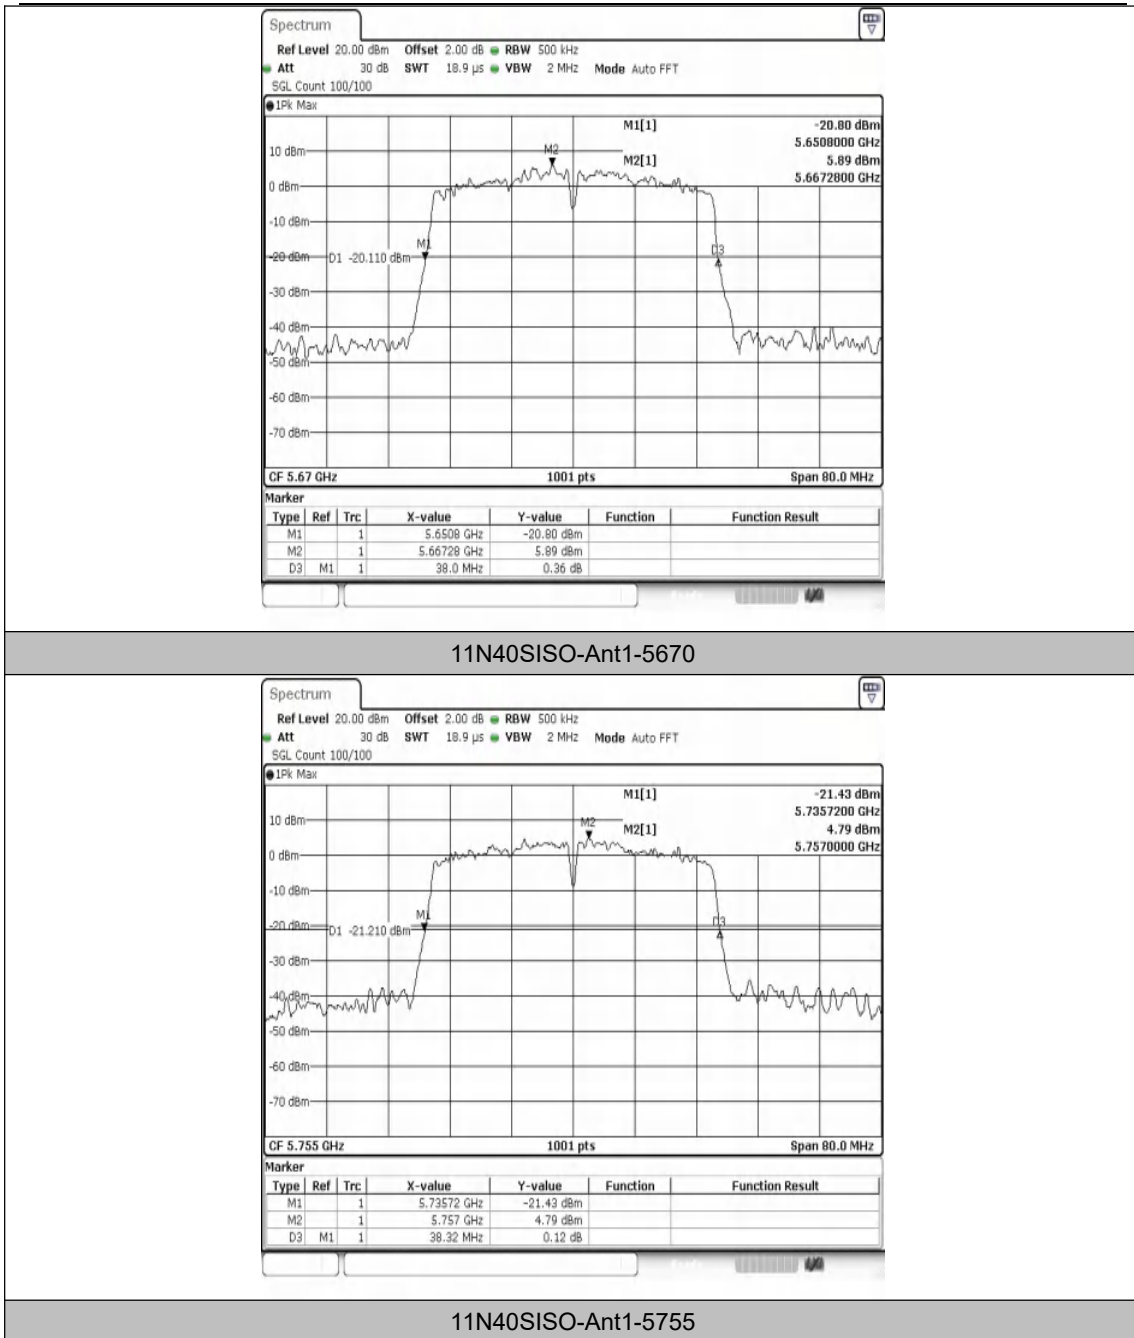


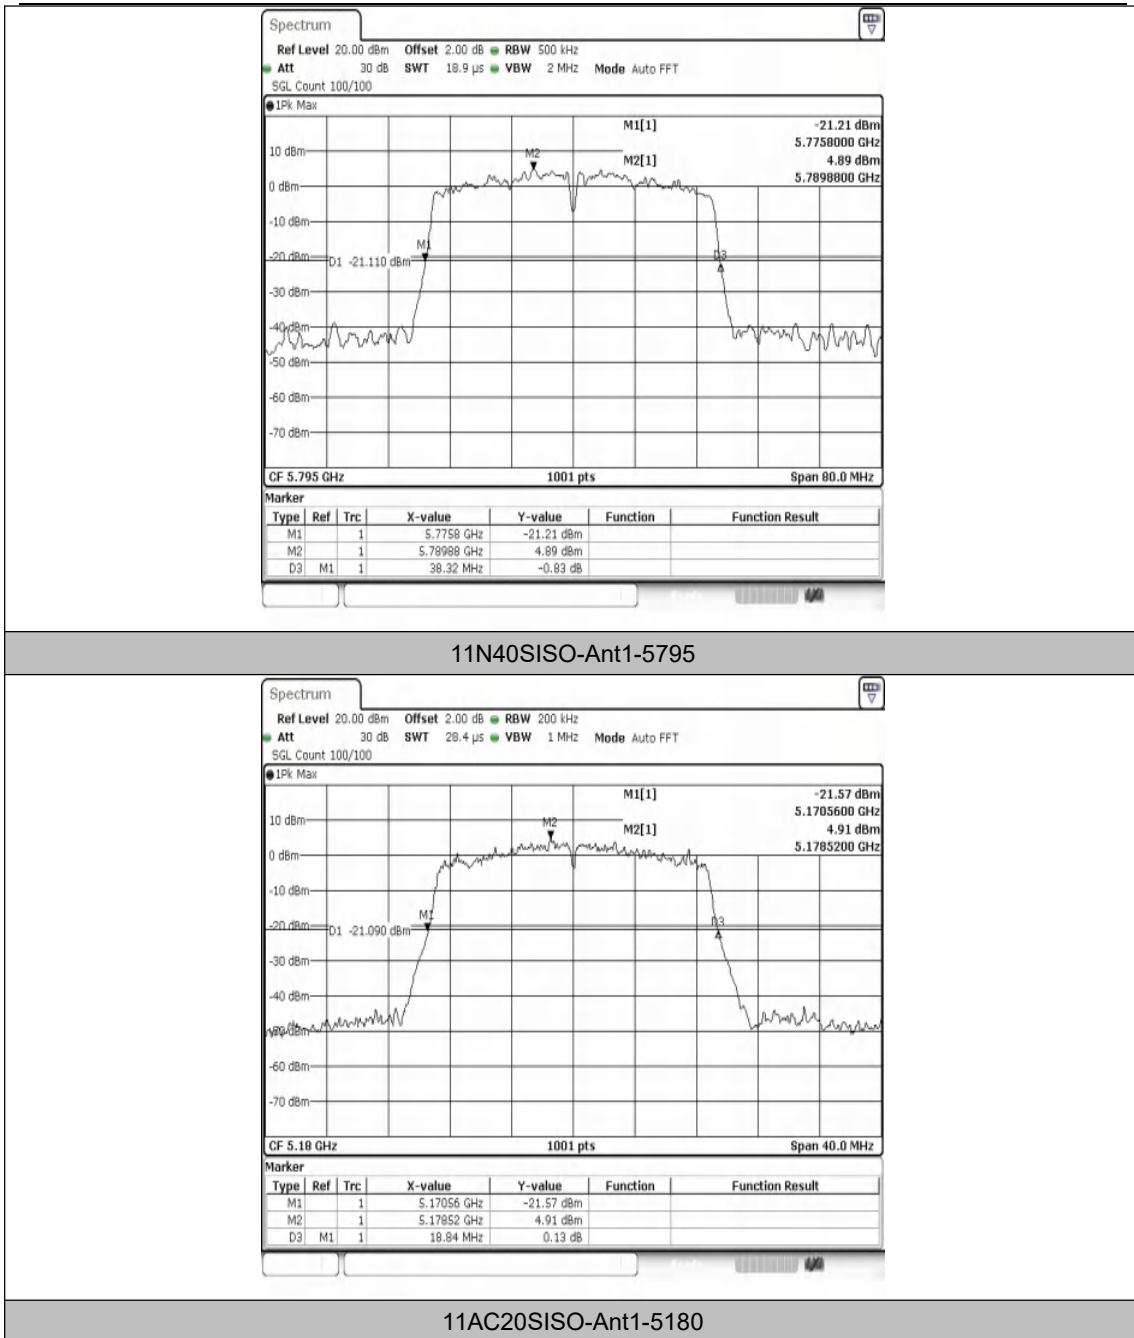


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

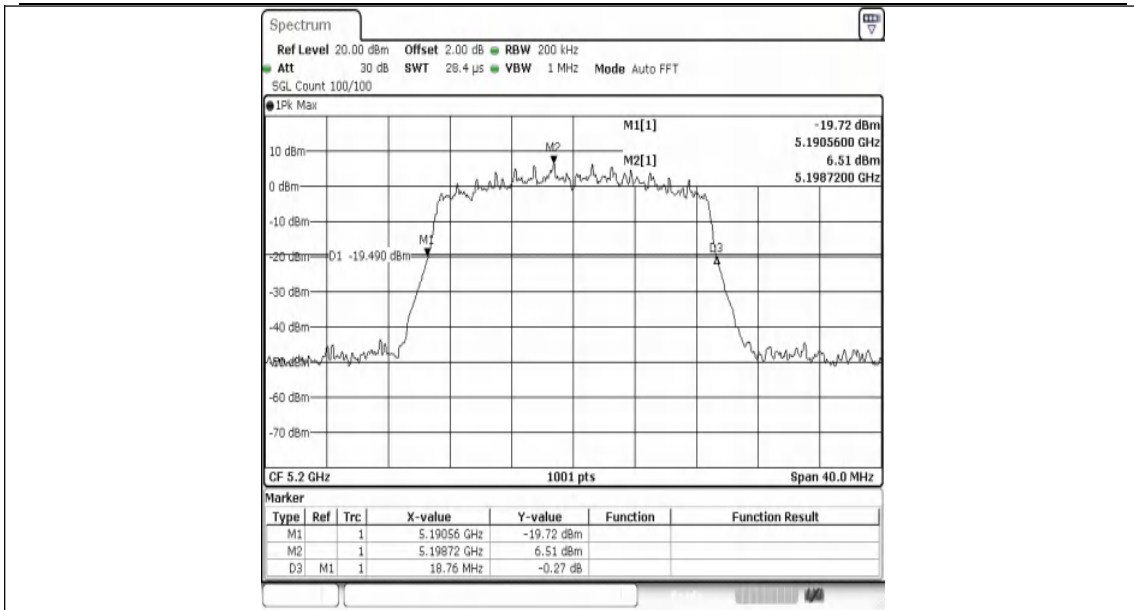


11AC20SISO-Ant1-5200

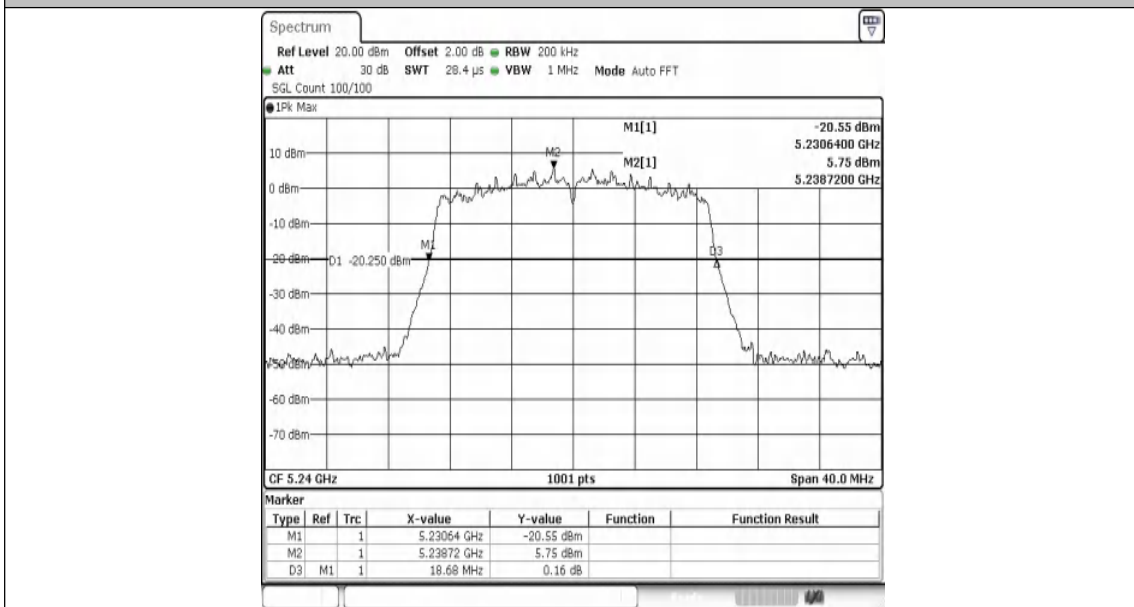

11AC20SISO-Ant1-5240

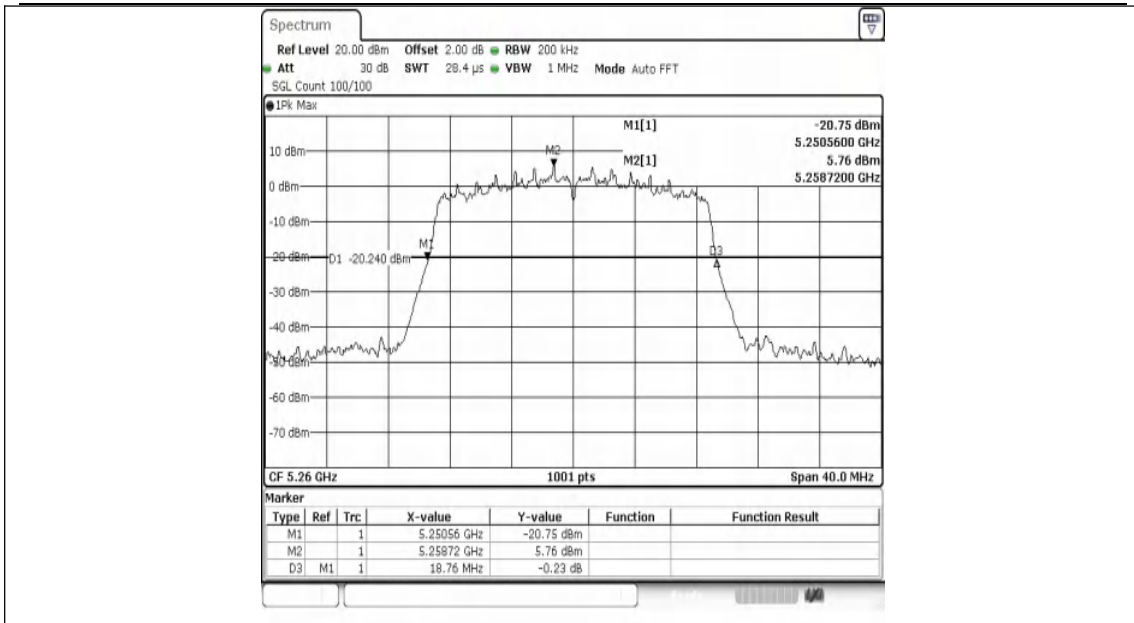

11AC20SISO-Ant1-5260

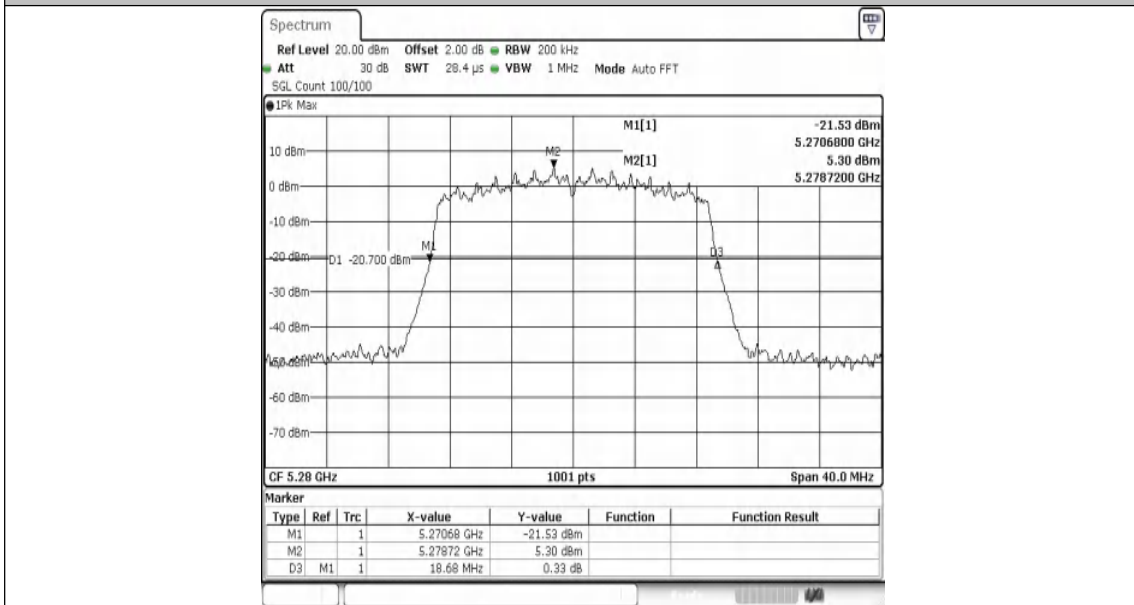


11AC20SISO-Ant1-5280


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

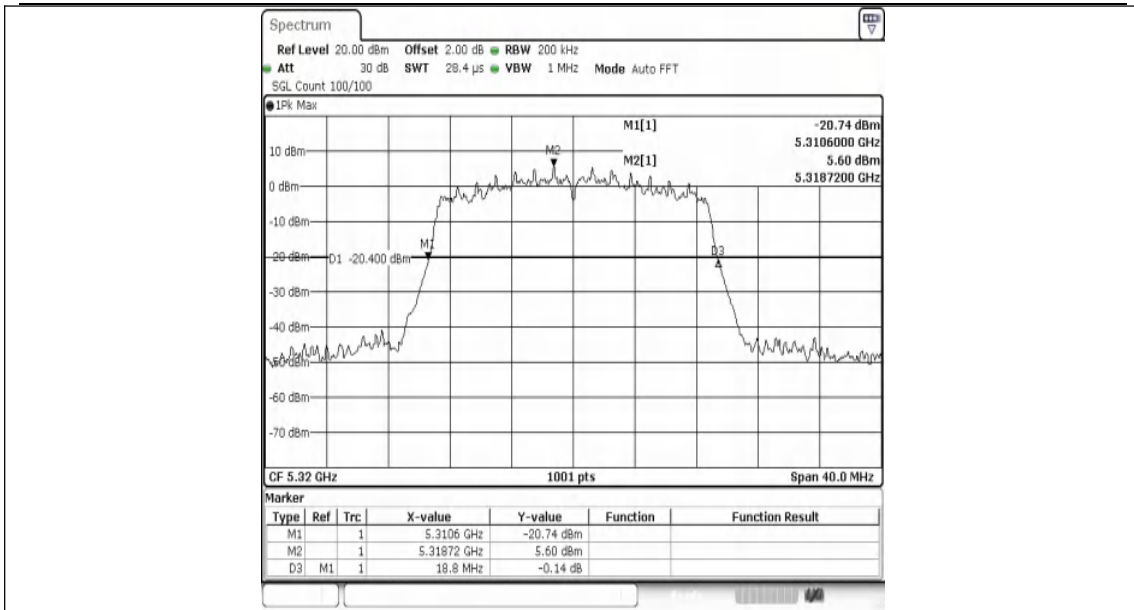



11AC20SISO-Ant1-5320

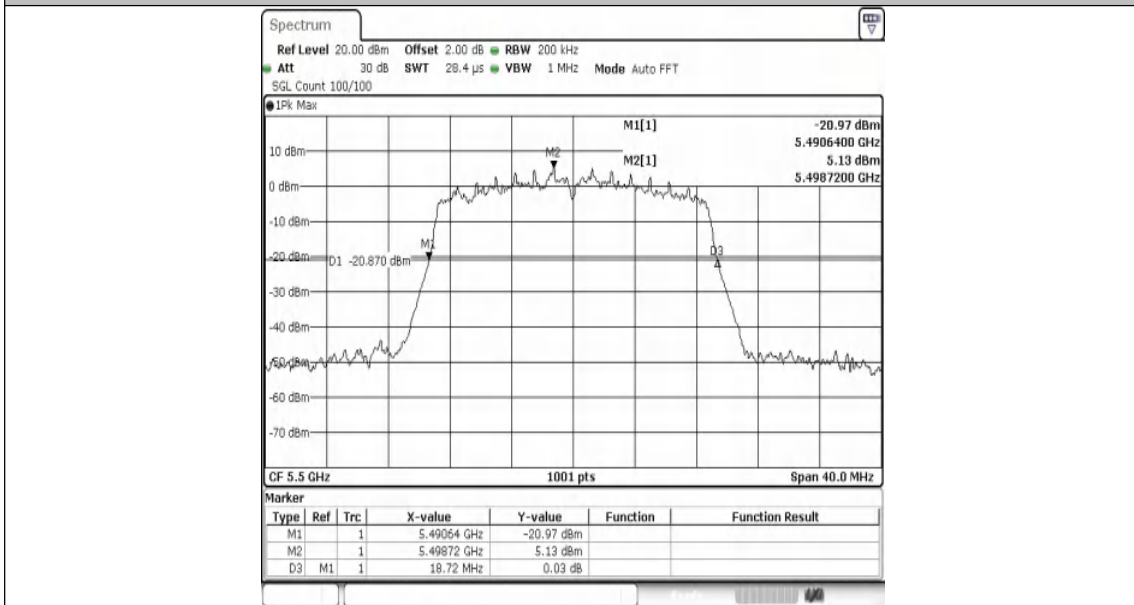


11AC20SISO-Ant1-5500

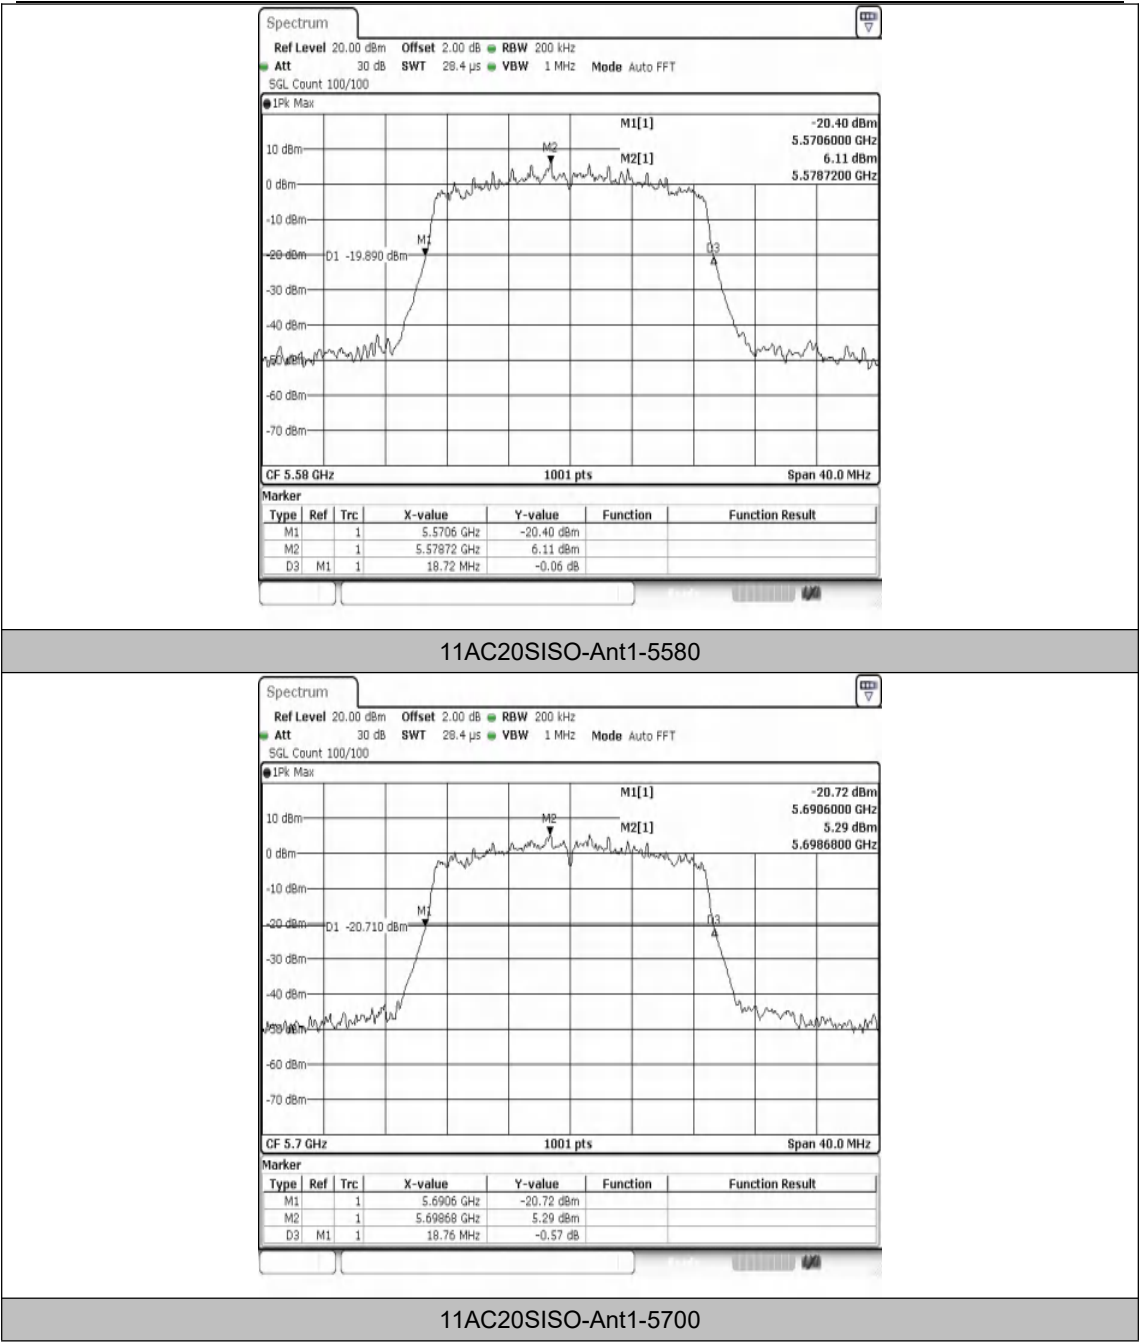

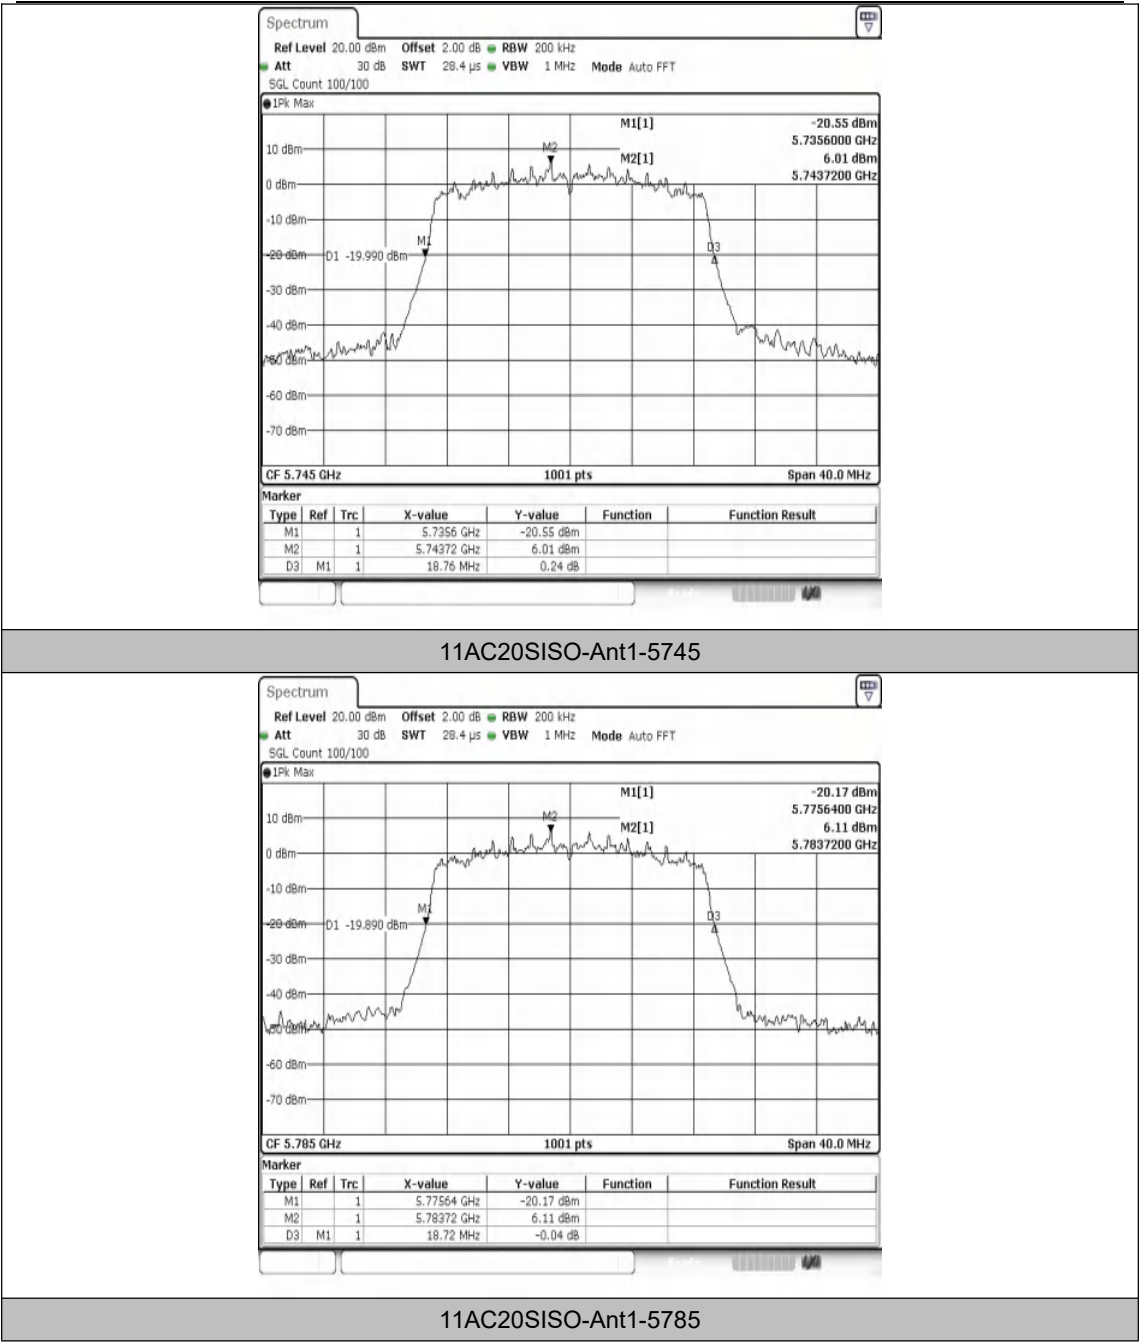


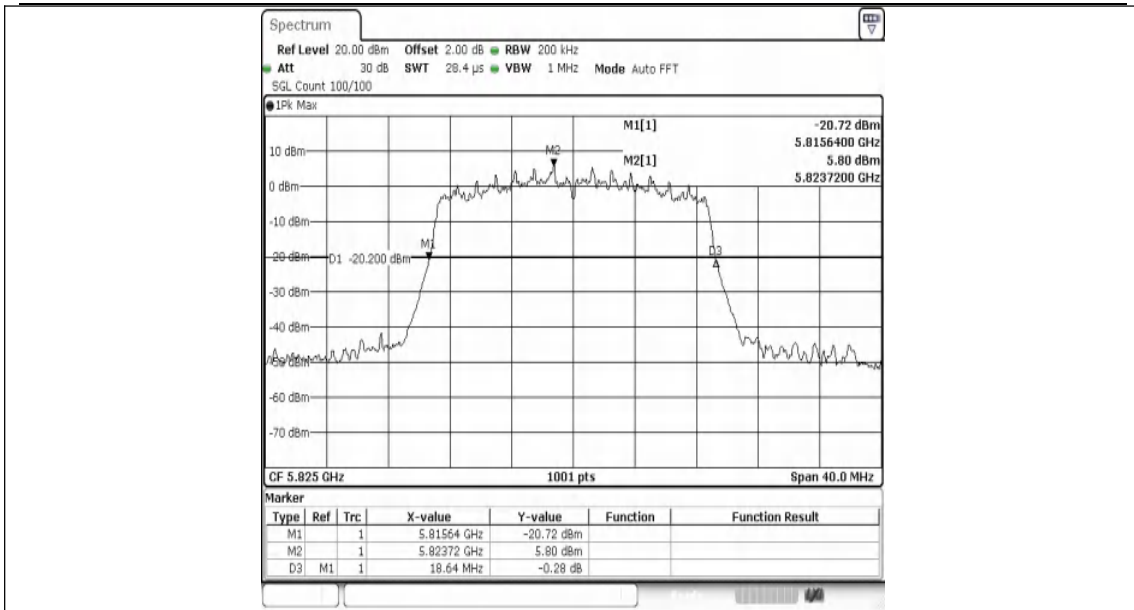


11AC20SISO-Ant1-5825

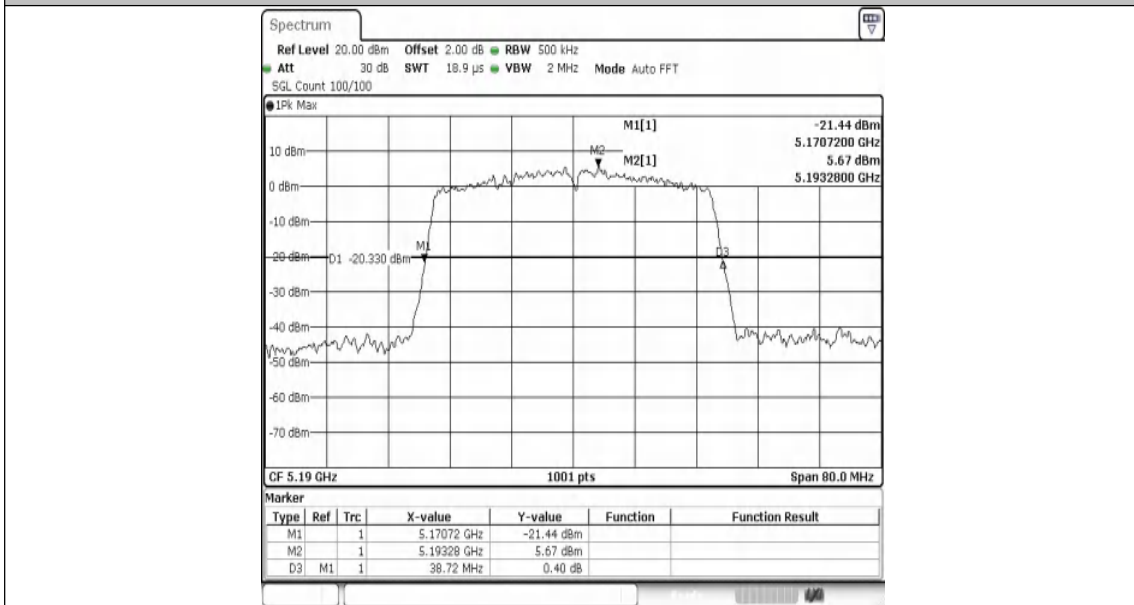


11AC40SISO-Ant1-5190

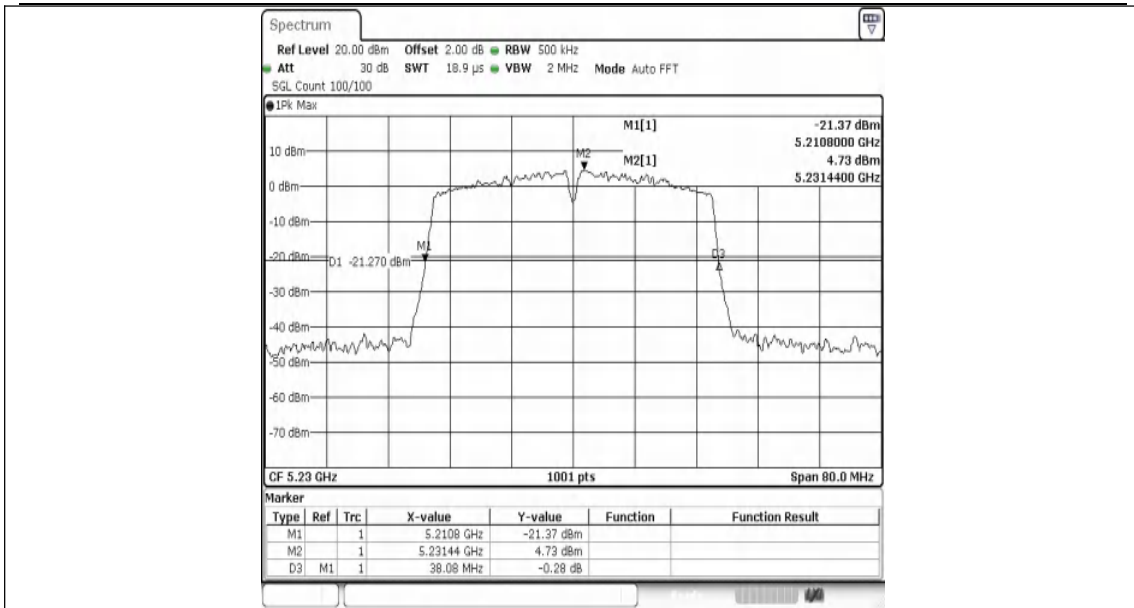


11AC40SISO-Ant1-5230

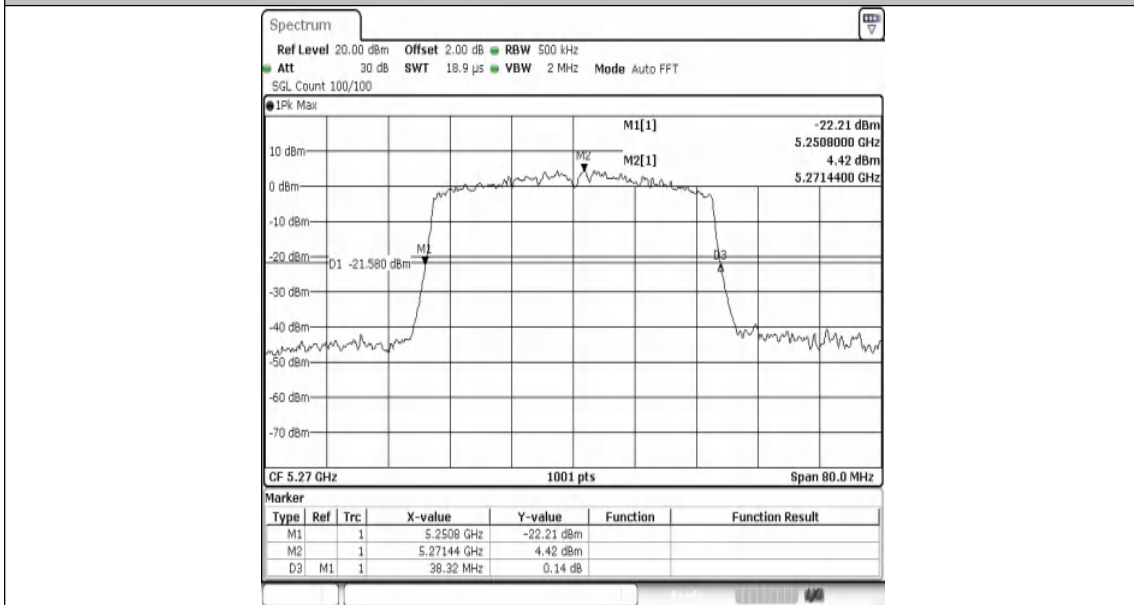


11AC40SISO-Ant1-5270

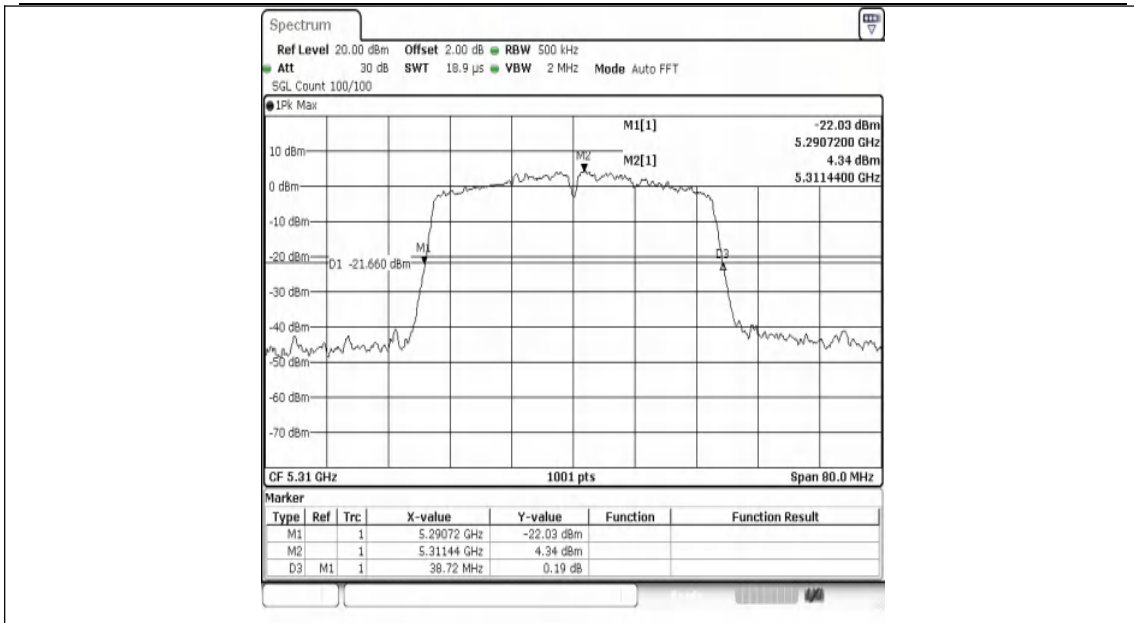



11AC40SISO-Ant1-5310

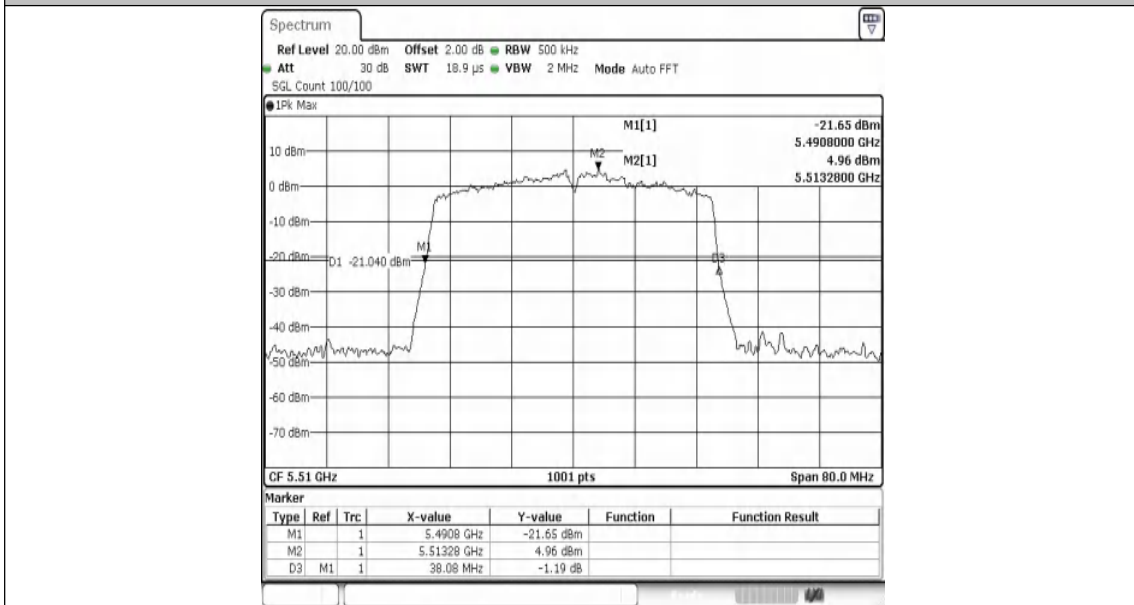


11AC40SISO-Ant1-5510

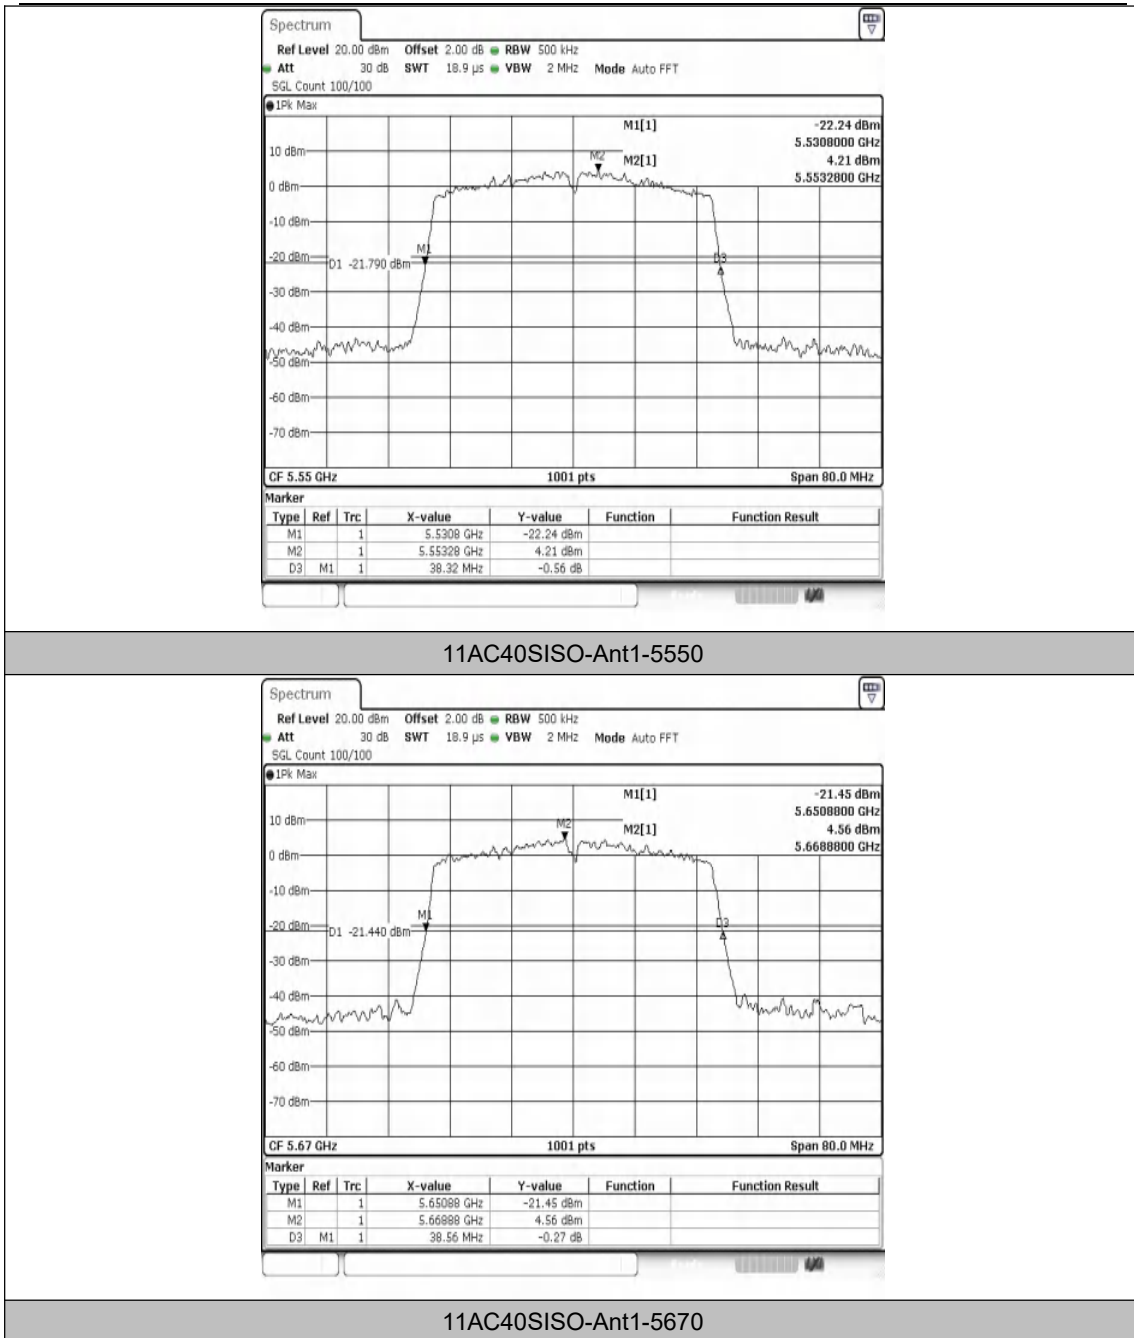


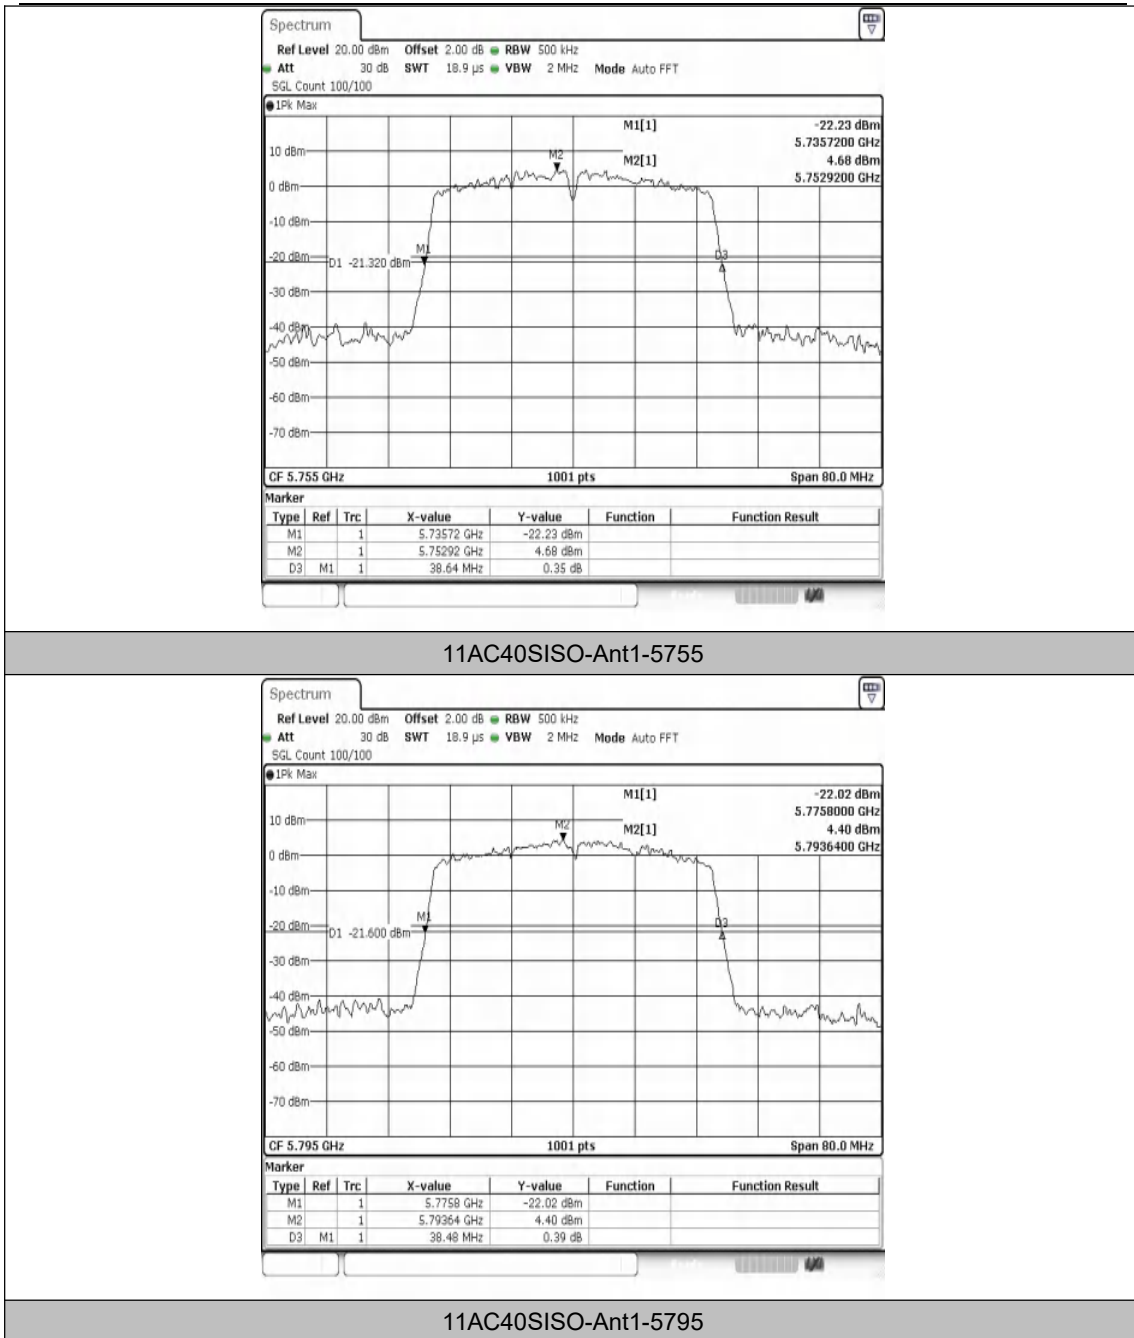

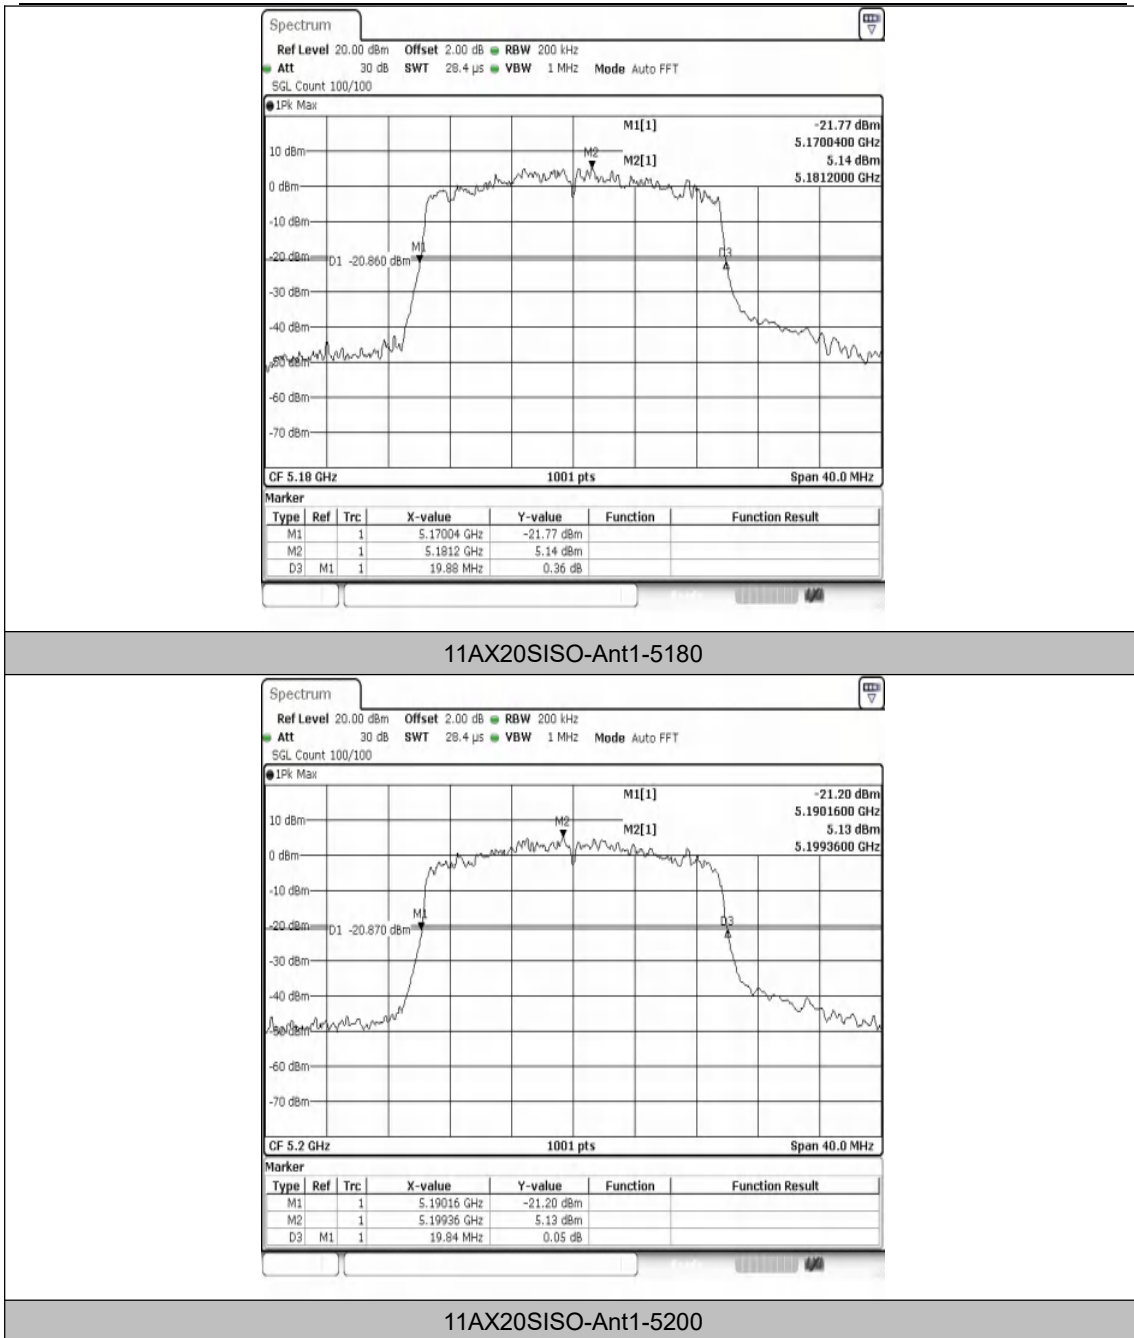


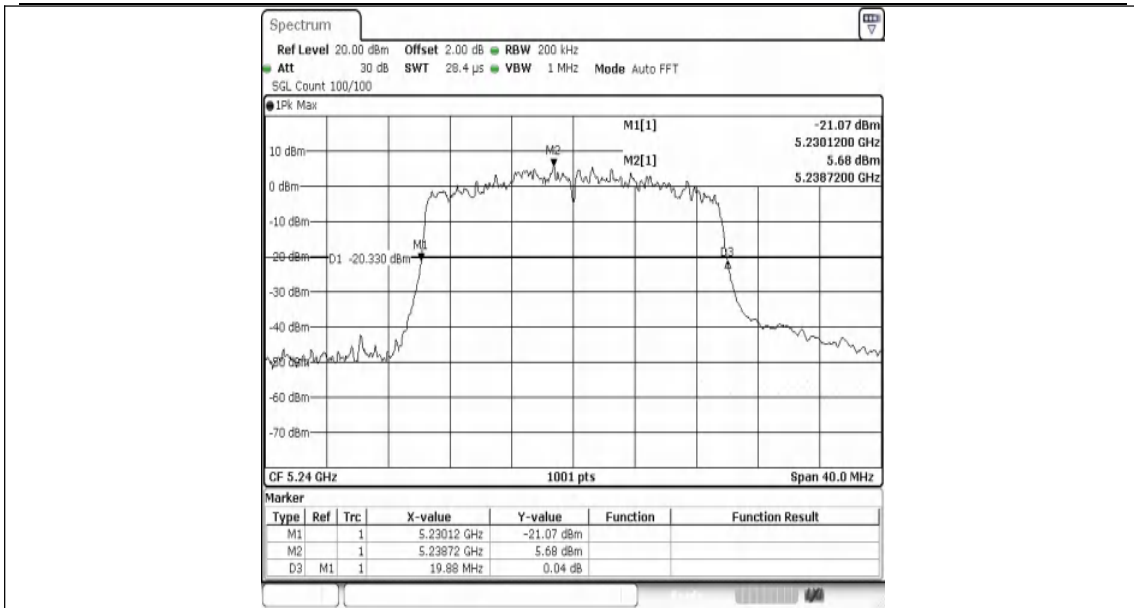



11AX20SISO-Ant1-5240

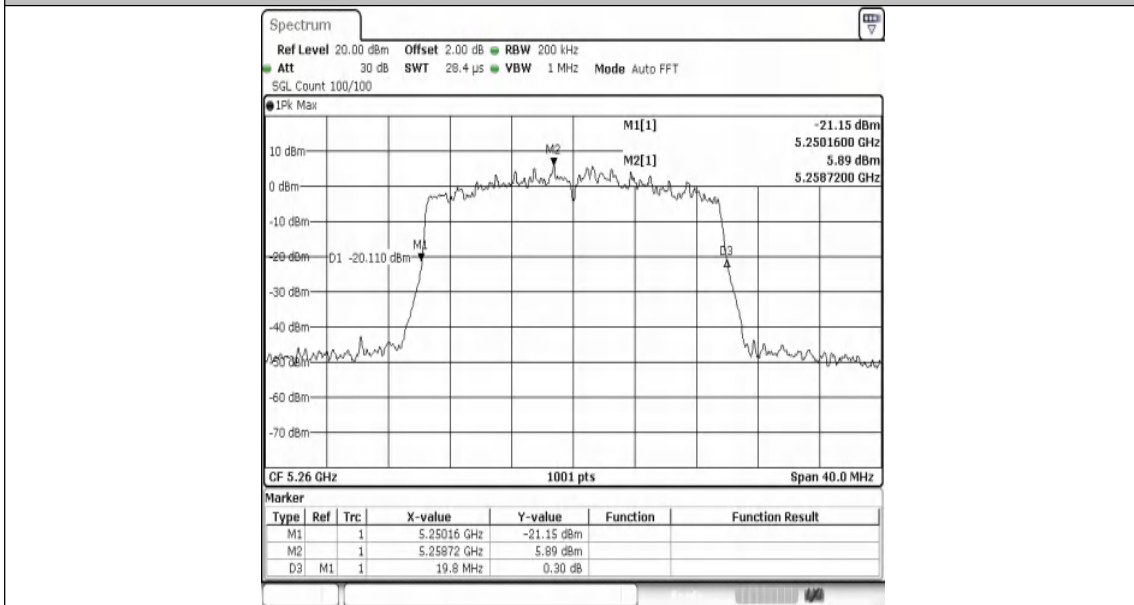



11AX20SISO-Ant1-5260

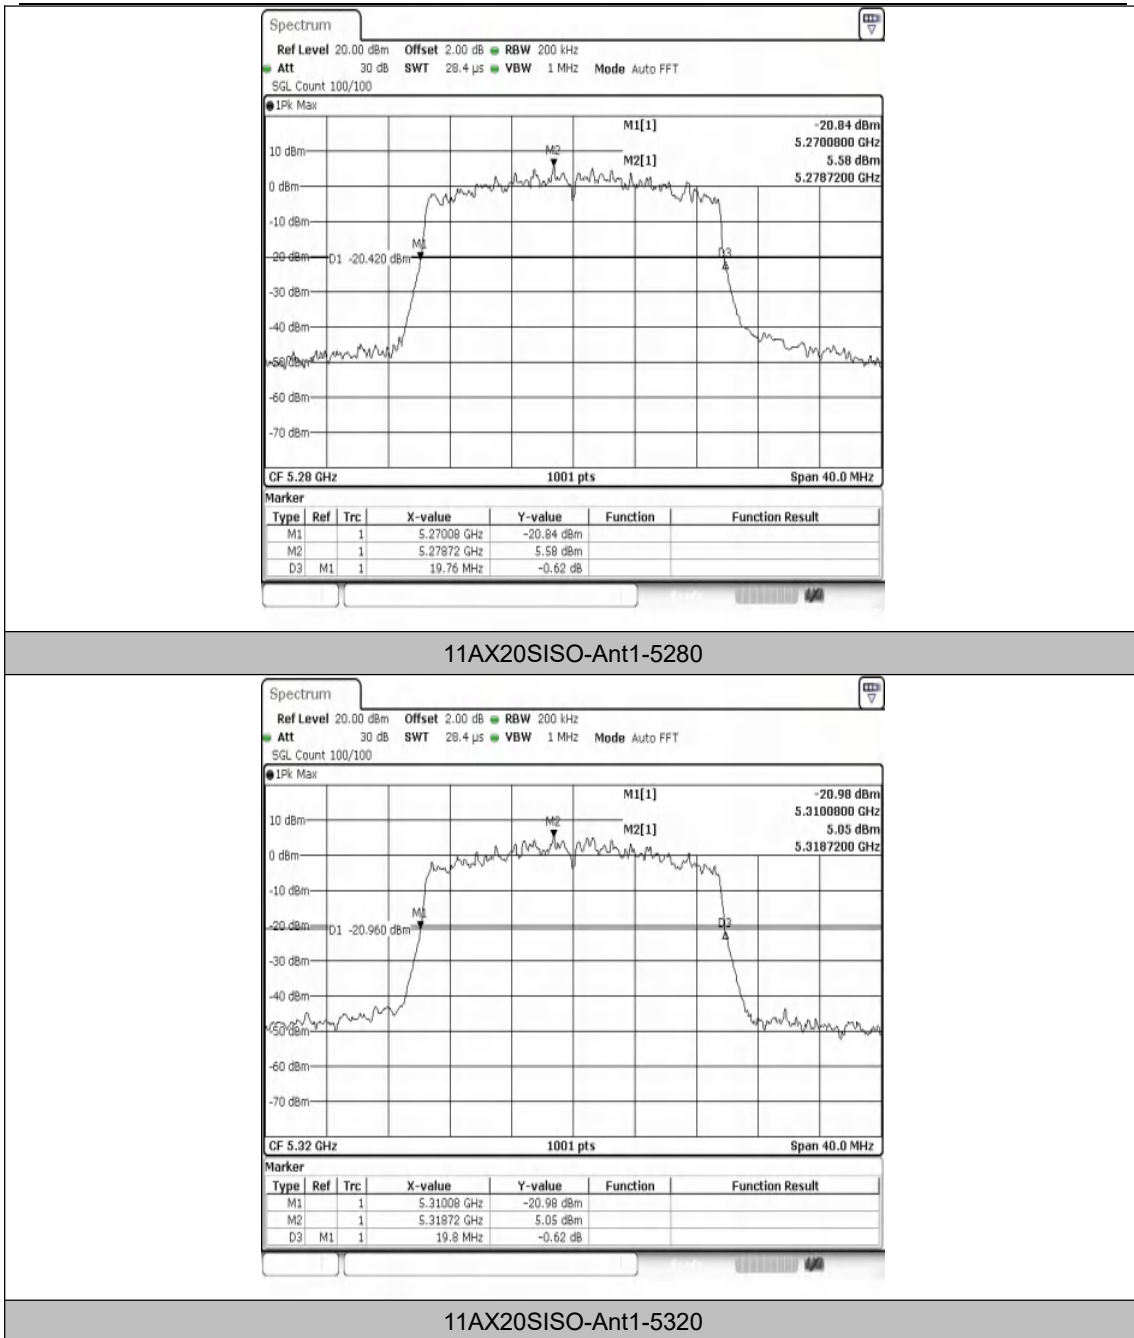

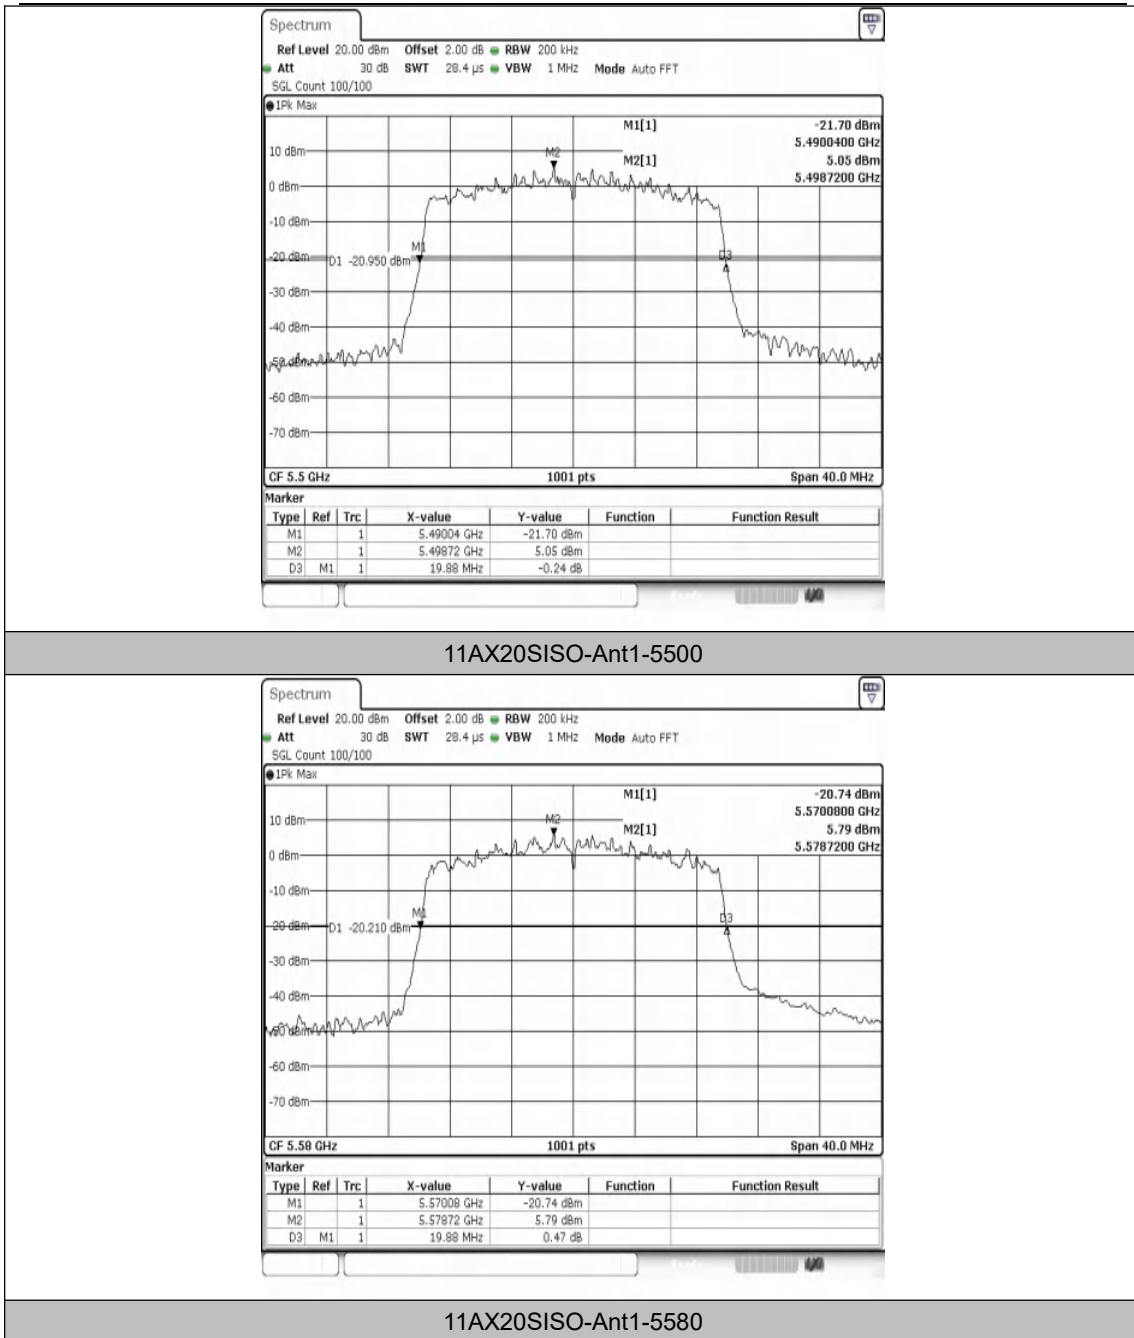


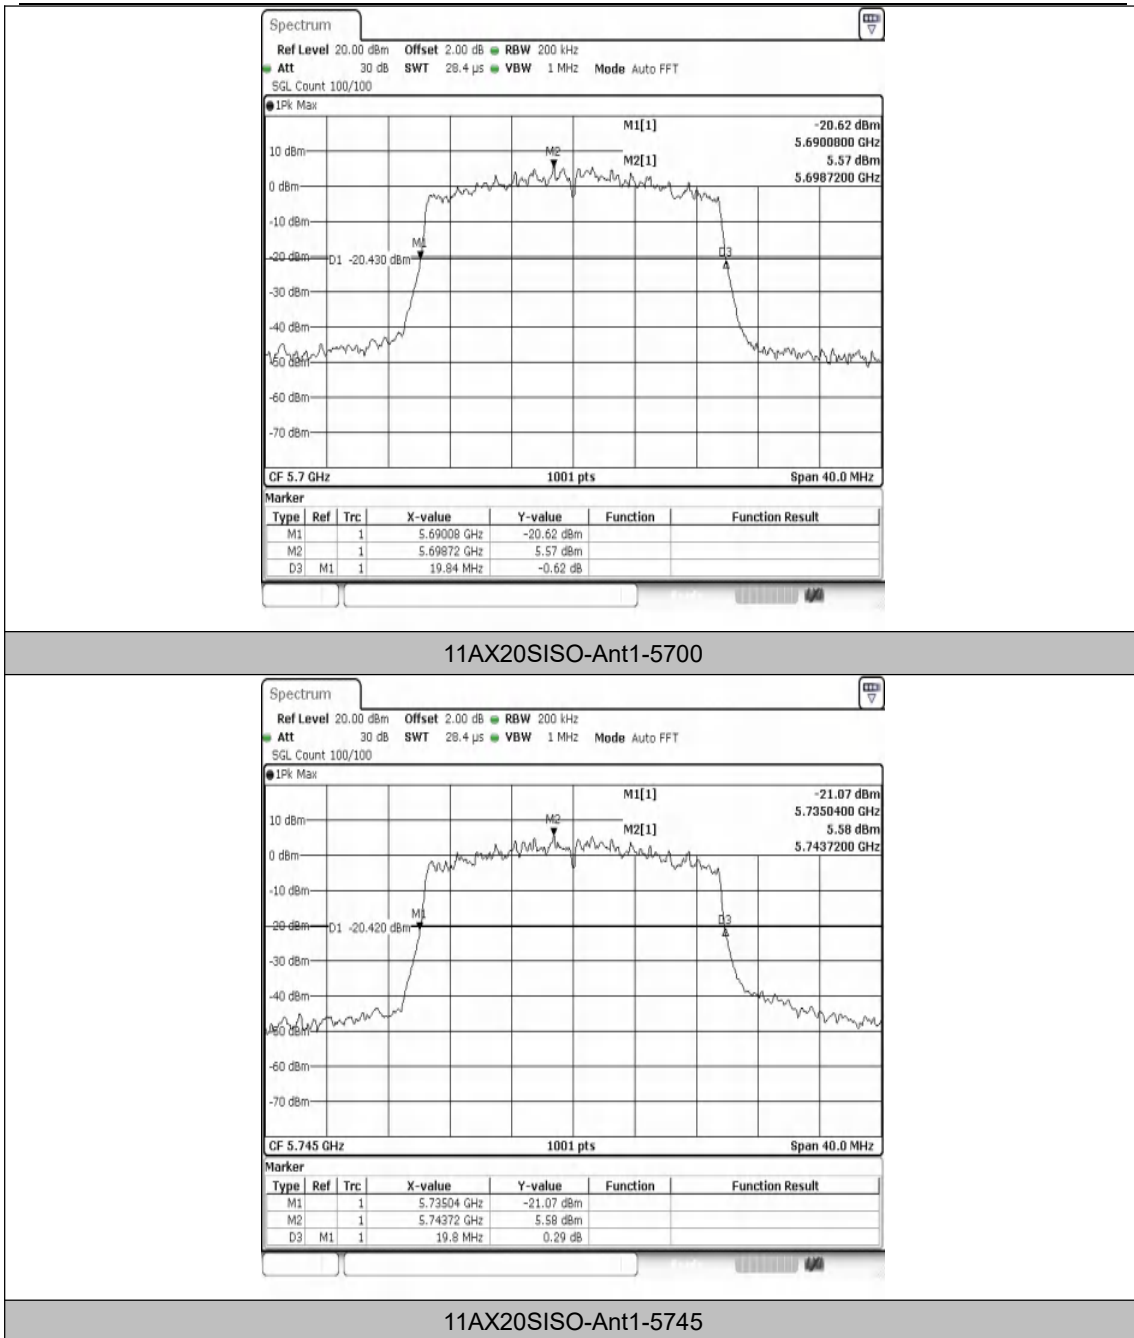

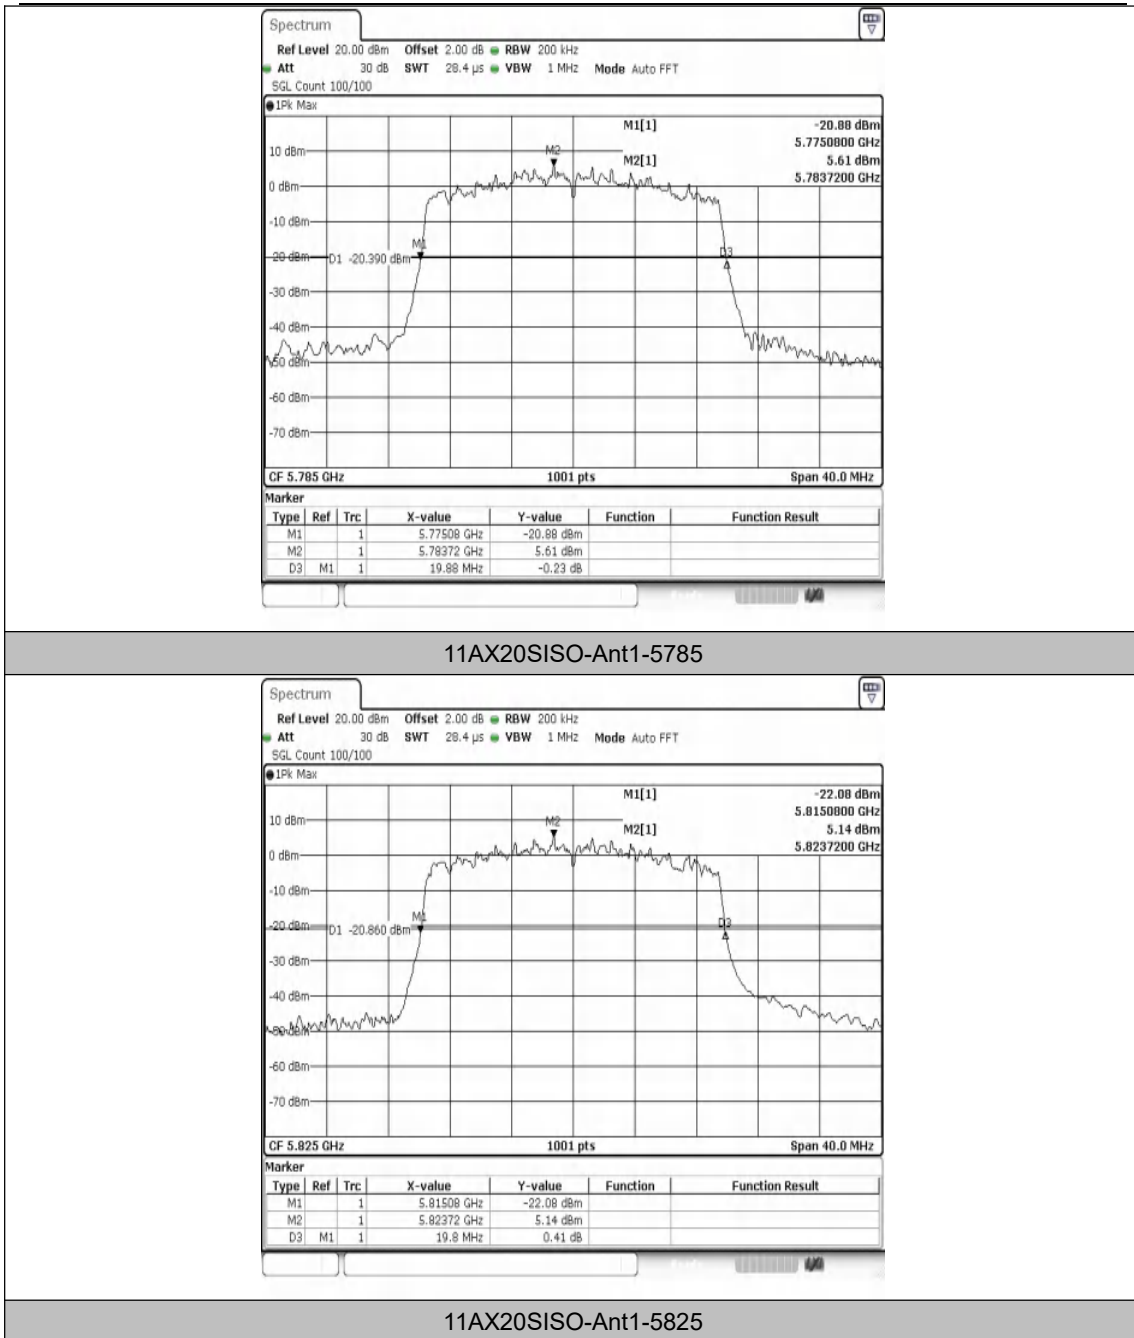


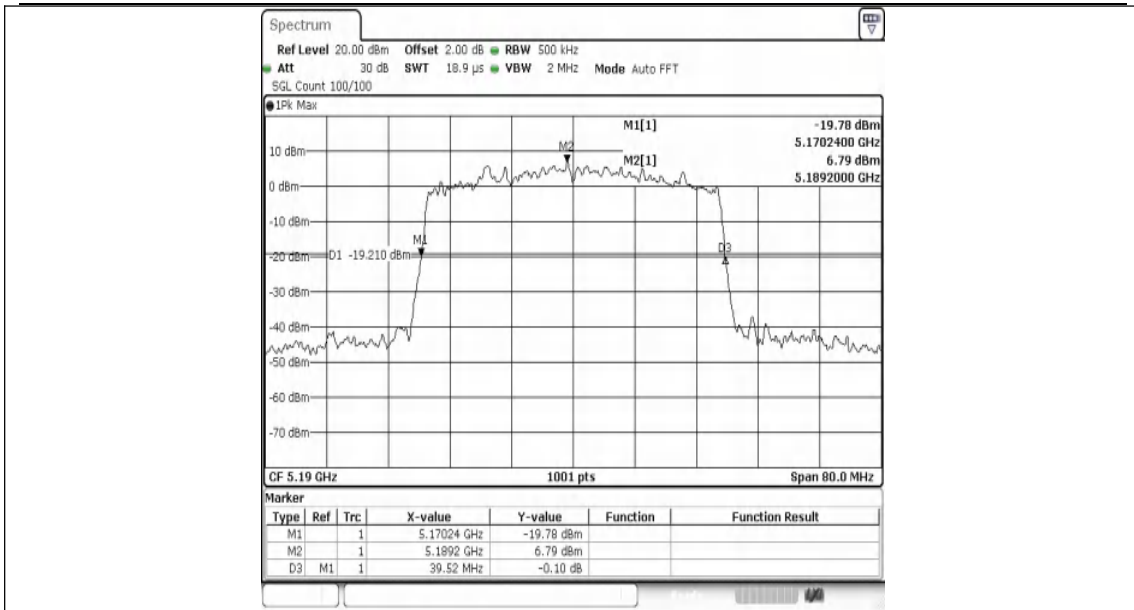


11AX40SISO-Ant1-5190

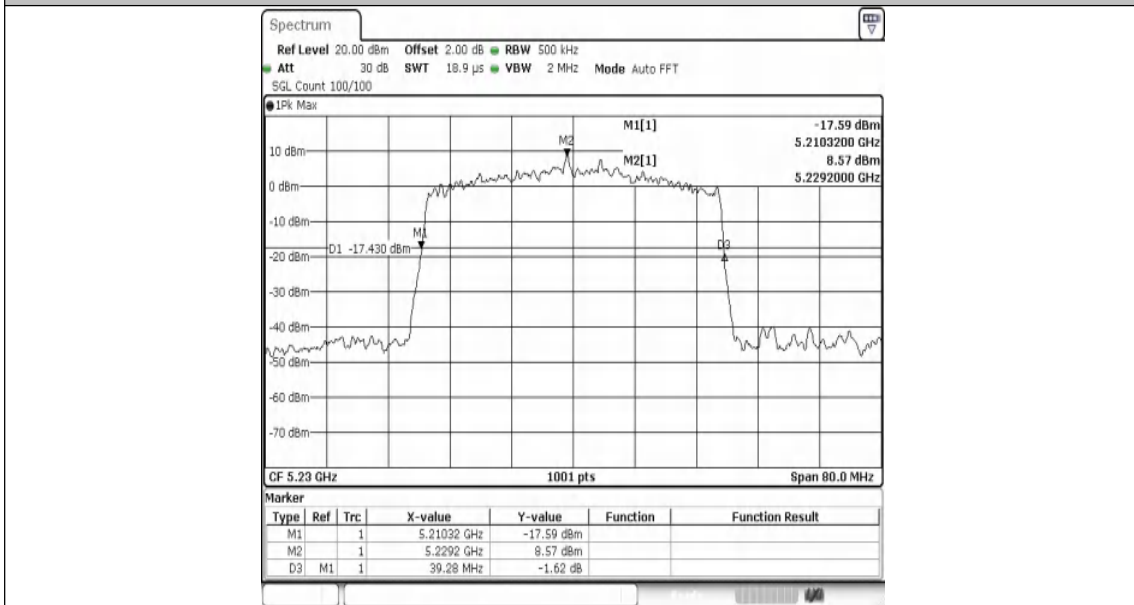


11AX40SISO-Ant1-5230

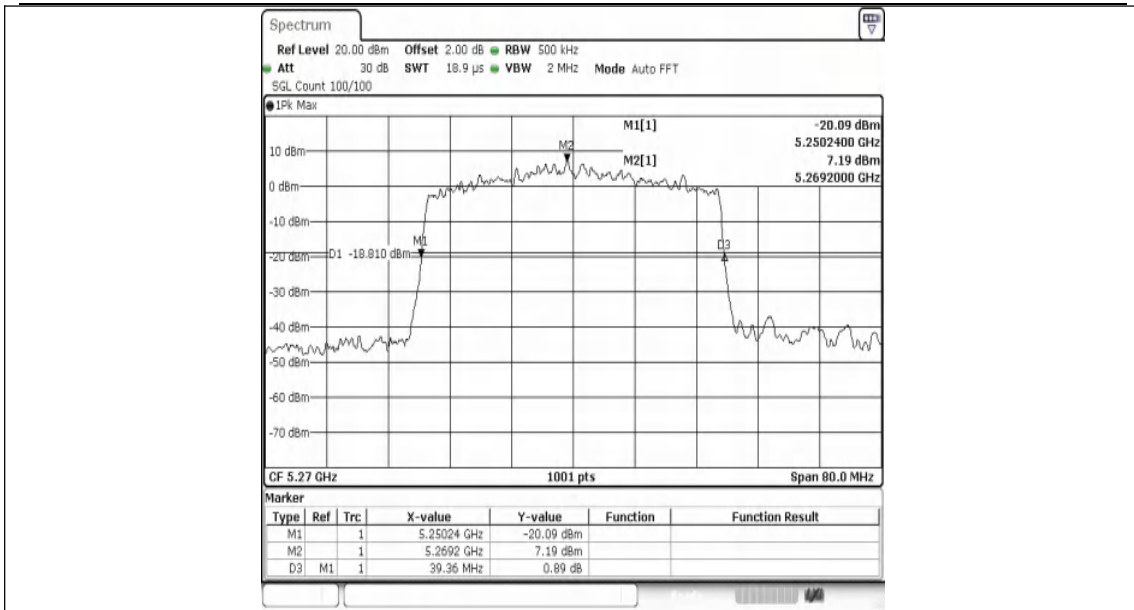


11AX40SISO-Ant1-5270

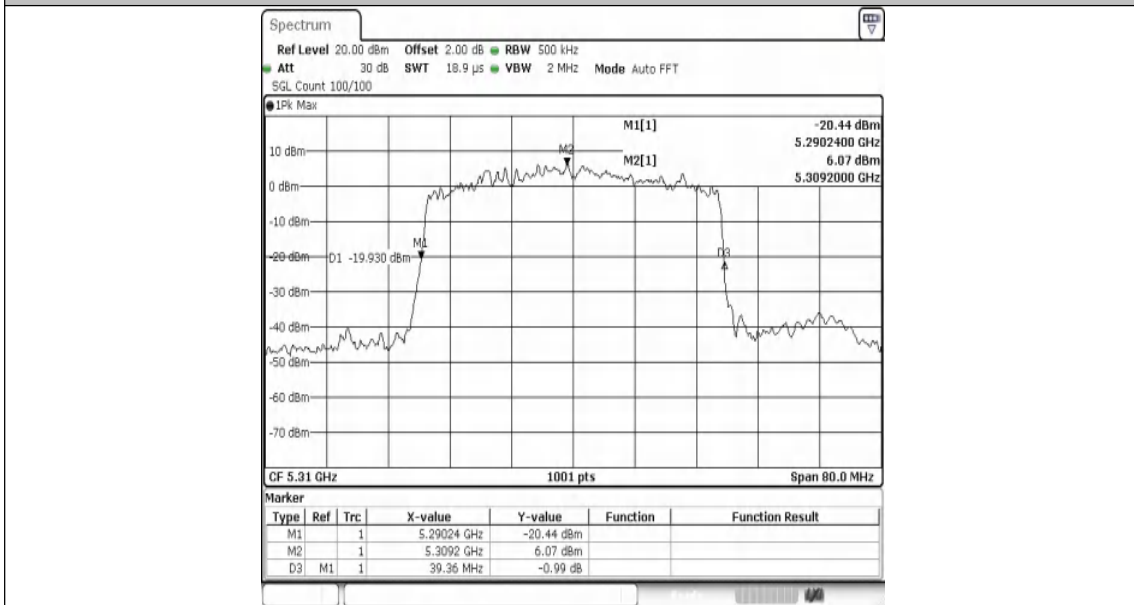


11AX40SISO-Ant1-5310

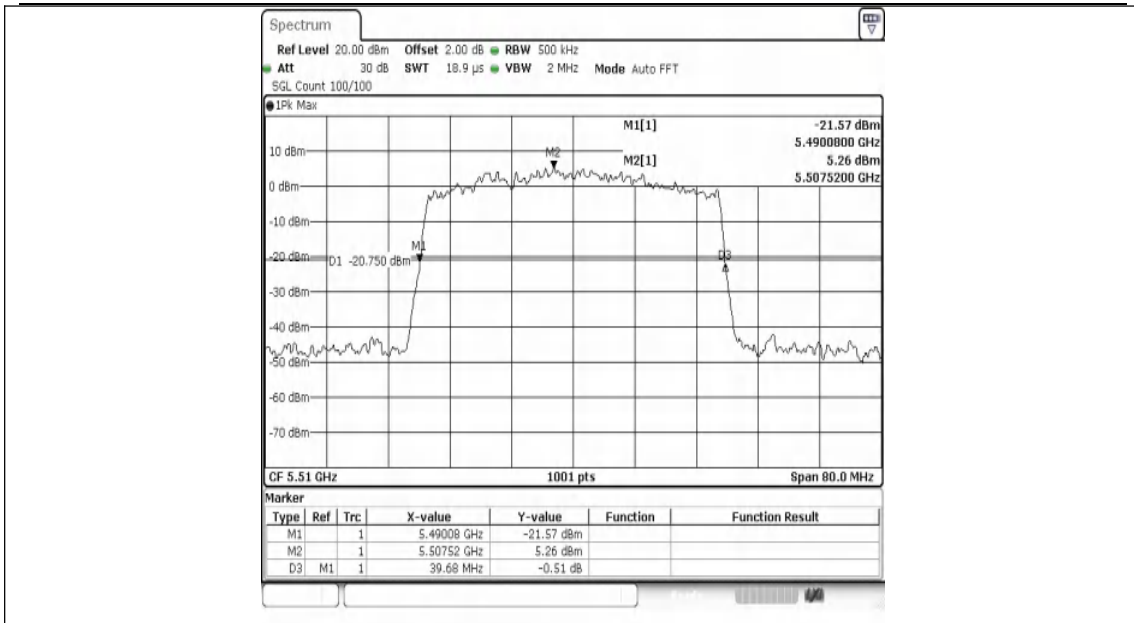

11AX40SISO-Ant1-5510

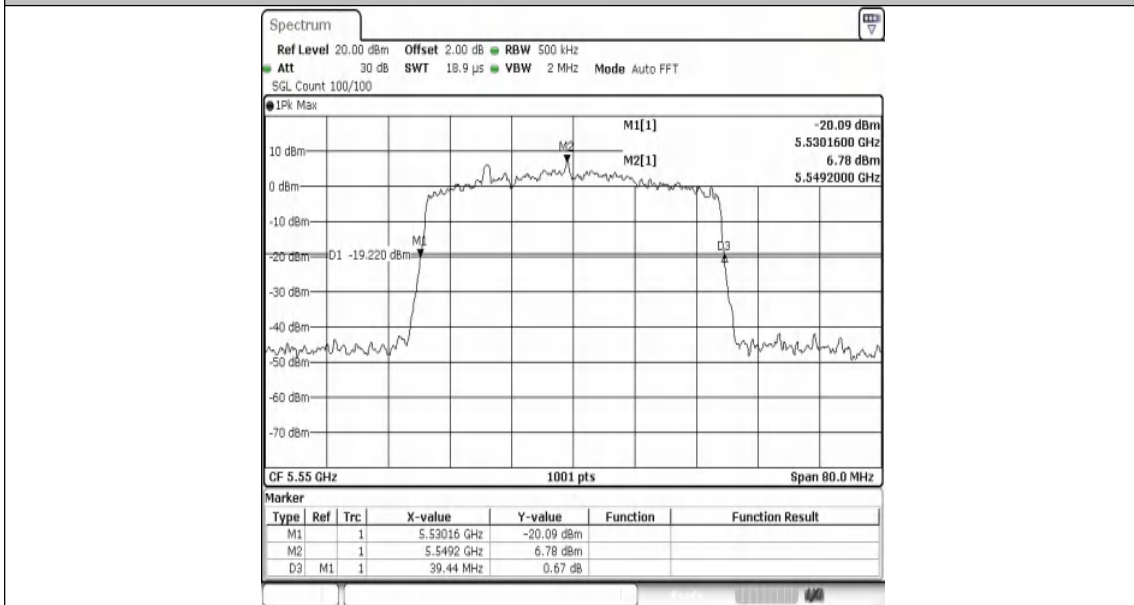

11AX40SISO-Ant1-5550

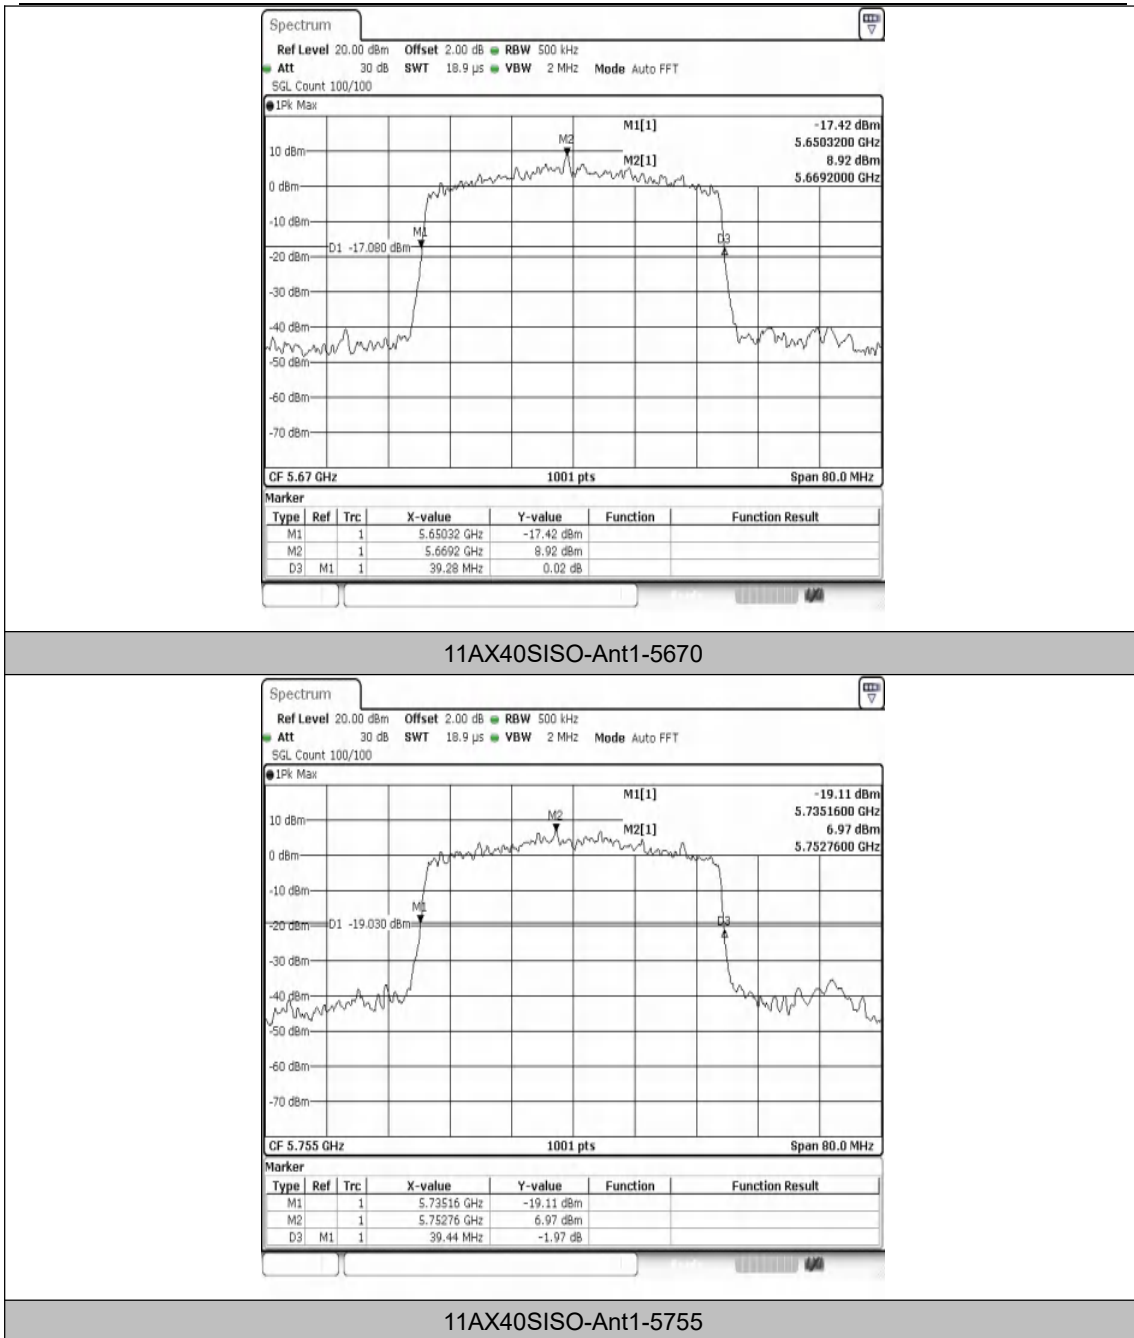

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.224	5171.8881	5188.1119	---	---
11A	Ant1	5200	16.224	5191.8881	5208.1119	---	---
11A	Ant1	5240	16.264	5231.8881	5248.1518	---	---
11A	Ant1	5260	16.224	5251.8881	5268.1119	---	---
11A	Ant1	5280	16.264	5271.8881	5288.1518	---	---
11A	Ant1	5320	16.184	5311.9281	5328.1119	---	---
11A	Ant1	5500	16.184	5491.9281	5508.1119	---	---
11A	Ant1	5580	16.264	5571.8881	5588.1518	---	---
11A	Ant1	5700	16.224	5691.8881	5708.1119	---	---
11A	Ant1	5745	16.264	5736.8881	5753.1518	---	---
11A	Ant1	5785	16.224	5776.8881	5793.1119	---	---
11A	Ant1	5825	16.264	5816.8482	5833.1119	---	---
11N20SISO	Ant1	5180	17.303	5171.3686	5188.6713	---	---
11N20SISO	Ant1	5200	17.343	5191.3287	5208.6713	---	---
11N20SISO	Ant1	5240	17.303	5231.3287	5248.6314	---	---
11N20SISO	Ant1	5260	17.343	5251.3287	5268.6713	---	---
11N20SISO	Ant1	5280	17.343	5271.3287	5288.6713	---	---
11N20SISO	Ant1	5320	17.343	5311.3287	5328.6713	---	---
11N20SISO	Ant1	5500	17.303	5491.3287	5508.6314	---	---
11N20SISO	Ant1	5580	17.343	5571.3287	5588.6713	---	---
11N20SISO	Ant1	5700	17.343	5691.3287	5708.6713	---	---
11N20SISO	Ant1	5745	17.303	5736.3287	5753.6314	---	---
11N20SISO	Ant1	5785	17.303	5776.3287	5793.6314	---	---
11N20SISO	Ant1	5825	17.343	5816.2887	5833.6314	---	---
11N40SISO	Ant1	5190	35.724	5172.0979	5207.8222	---	---
11N40SISO	Ant1	5230	35.724	5212.0979	5247.8222	---	---
11N40SISO	Ant1	5270	35.644	5252.0979	5287.7423	---	---
11N40SISO	Ant1	5310	35.724	5292.0979	5327.8222	---	---
11N40SISO	Ant1	5510	35.804	5492.0180	5527.8222	---	---
11N40SISO	Ant1	5550	35.724	5532.0180	5567.7423	---	---
11N40SISO	Ant1	5670	35.644	5652.0979	5687.7423	---	---
11N40SISO	Ant1	5755	35.644	5737.0979	5772.7423	---	---
11N40SISO	Ant1	5795	35.724	5777.0180	5812.7423	---	---
11AC20SISO	Ant1	5180	17.383	5171.2887	5188.6713	---	---
11AC20SISO	Ant1	5200	17.343	5191.2887	5208.6314	---	---
11AC20SISO	Ant1	5240	17.423	5231.2488	5248.6713	---	---
11AC20SISO	Ant1	5260	17.383	5251.2887	5268.6713	---	---

11AC20SISO	Ant1	5280	17.383	5271.2887	5288.6713	---	---
11AC20SISO	Ant1	5320	17.423	5311.2887	5328.7113	---	---
11AC20SISO	Ant1	5500	17.383	5491.2887	5508.6713	---	---
11AC20SISO	Ant1	5580	17.463	5571.2488	5588.7113	---	---
11AC20SISO	Ant1	5700	17.423	5691.2887	5708.7113	---	---
11AC20SISO	Ant1	5745	17.383	5736.2887	5753.6713	---	---
11AC20SISO	Ant1	5785	17.423	5776.2488	5793.6713	---	---
11AC20SISO	Ant1	5825	17.423	5816.2488	5833.6713	---	---
11AC40SISO	Ant1	5190	35.485	5172.2577	5207.7423	---	---
11AC40SISO	Ant1	5230	35.485	5212.2577	5247.7423	---	---
11AC40SISO	Ant1	5270	35.485	5252.2577	5287.7423	---	---
11AC40SISO	Ant1	5310	35.564	5292.2577	5327.8222	---	---
11AC40SISO	Ant1	5510	35.485	5492.2577	5527.7423	---	---
11AC40SISO	Ant1	5550	35.405	5532.2577	5567.6623	---	---
11AC40SISO	Ant1	5670	35.485	5652.2577	5687.7423	---	---
11AC40SISO	Ant1	5755	35.485	5737.2577	5772.7423	---	---
11AC40SISO	Ant1	5795	35.325	5777.2577	5812.5824	---	---
11AX20SISO	Ant1	5180	18.661	5170.6094	5189.2707	---	---
11AX20SISO	Ant1	5200	18.541	5190.6893	5209.2308	---	---
11AX20SISO	Ant1	5240	18.621	5230.6094	5249.2308	---	---
11AX20SISO	Ant1	5260	18.581	5250.6494	5269.2308	---	---
11AX20SISO	Ant1	5280	18.621	5270.6094	5289.2308	---	---
11AX20SISO	Ant1	5320	18.581	5310.6494	5329.2308	---	---
11AX20SISO	Ant1	5500	18.581	5490.6094	5509.1908	---	---
11AX20SISO	Ant1	5580	18.541	5570.6494	5589.1908	---	---
11AX20SISO	Ant1	5700	18.621	5690.6094	5709.2308	---	---
11AX20SISO	Ant1	5745	18.581	5735.6494	5754.2308	---	---
11AX20SISO	Ant1	5785	18.581	5775.6094	5794.1908	---	---
11AX20SISO	Ant1	5825	18.541	5815.6494	5834.1908	---	---
11AX40SISO	Ant1	5190	36.923	5171.6184	5208.5415	---	---
11AX40SISO	Ant1	5230	36.923	5211.6184	5248.5415	---	---
11AX40SISO	Ant1	5270	37.003	5251.5385	5288.5415	---	---
11AX40SISO	Ant1	5310	36.923	5291.6184	5328.5415	---	---
11AX40SISO	Ant1	5510	36.763	5491.6184	5528.3816	---	---
11AX40SISO	Ant1	5550	37.003	5531.5385	5568.5415	---	---
11AX40SISO	Ant1	5670	36.923	5651.5385	5688.4615	---	---
11AX40SISO	Ant1	5755	37.003	5736.5385	5773.5415	---	---
11AX40SISO	Ant1	5795	36.923	5776.5385	5813.4615	---	---


Test Graphs

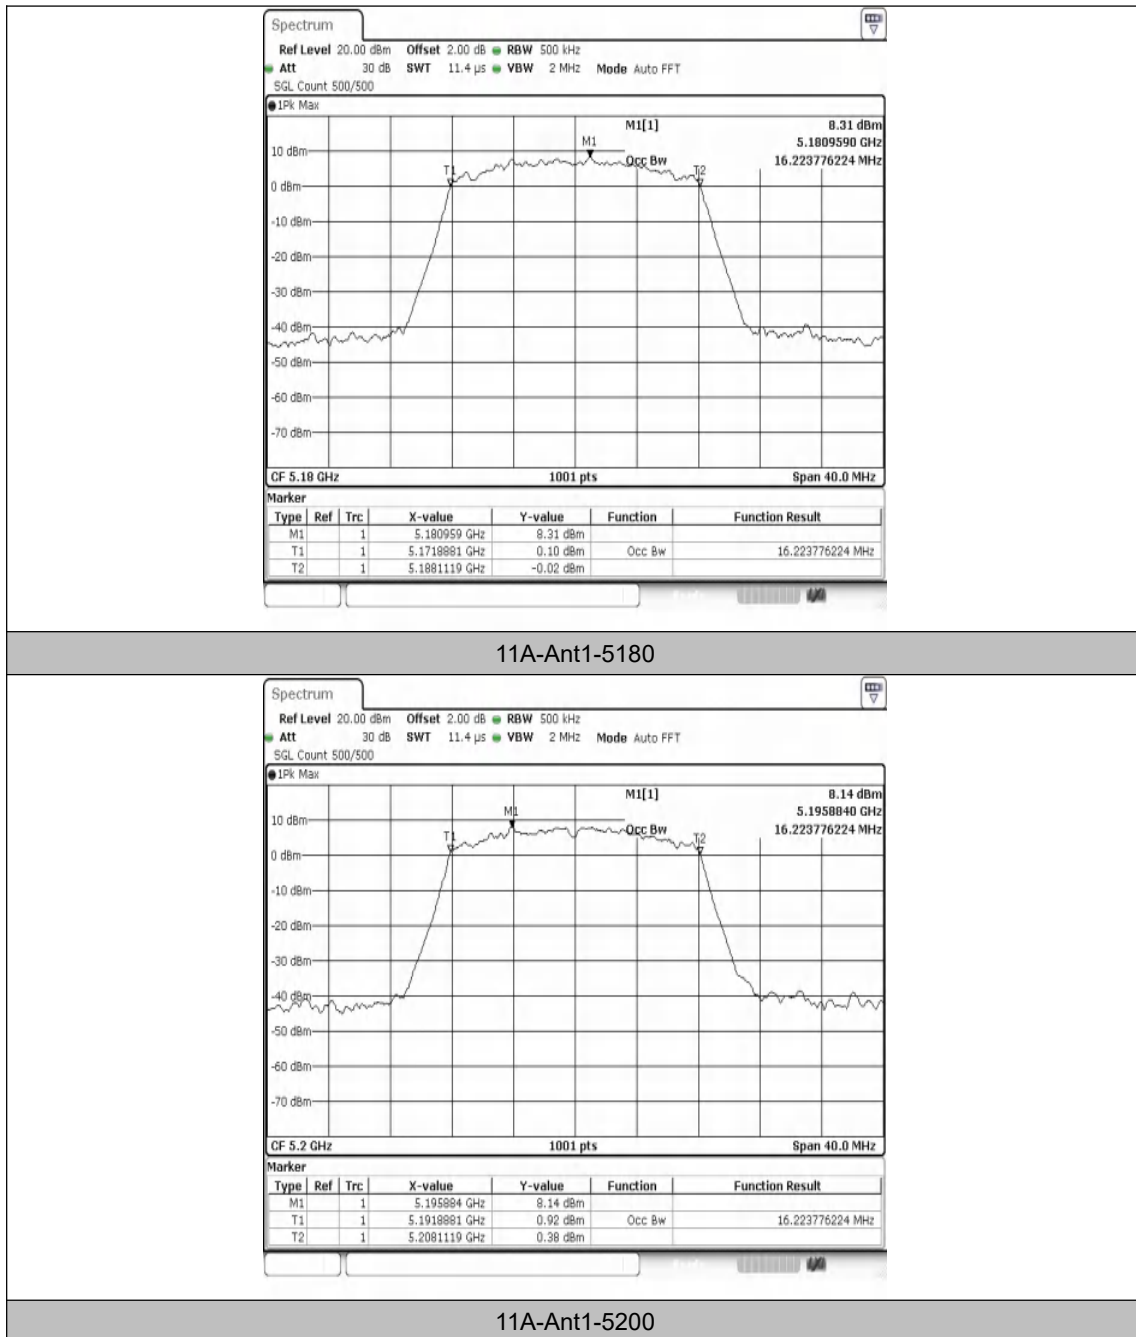


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

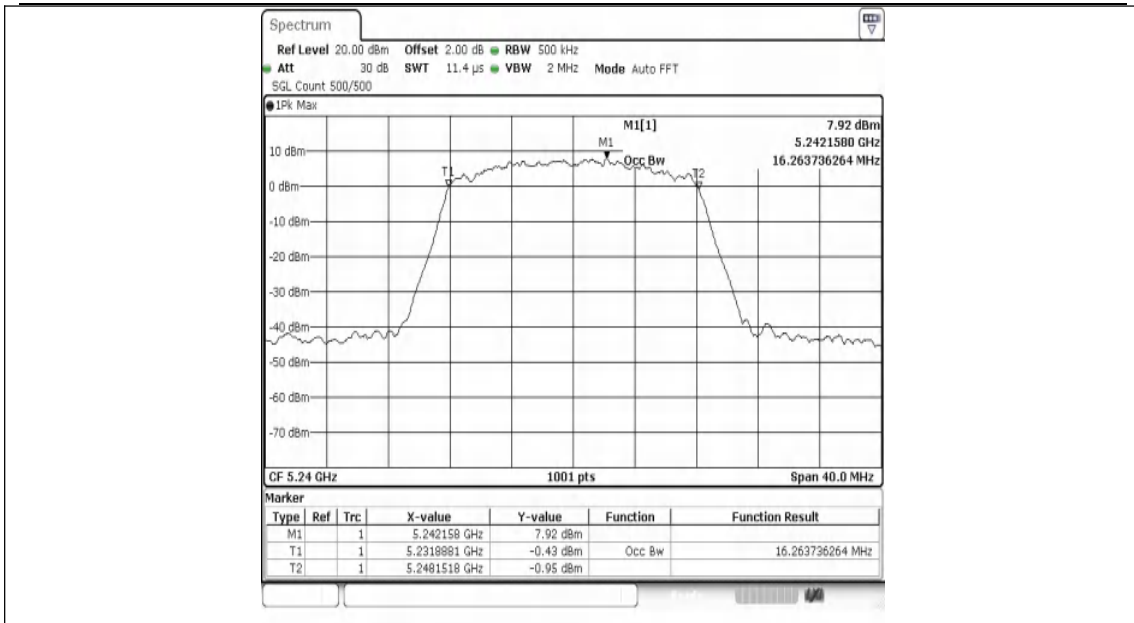


11A-Ant1-5240

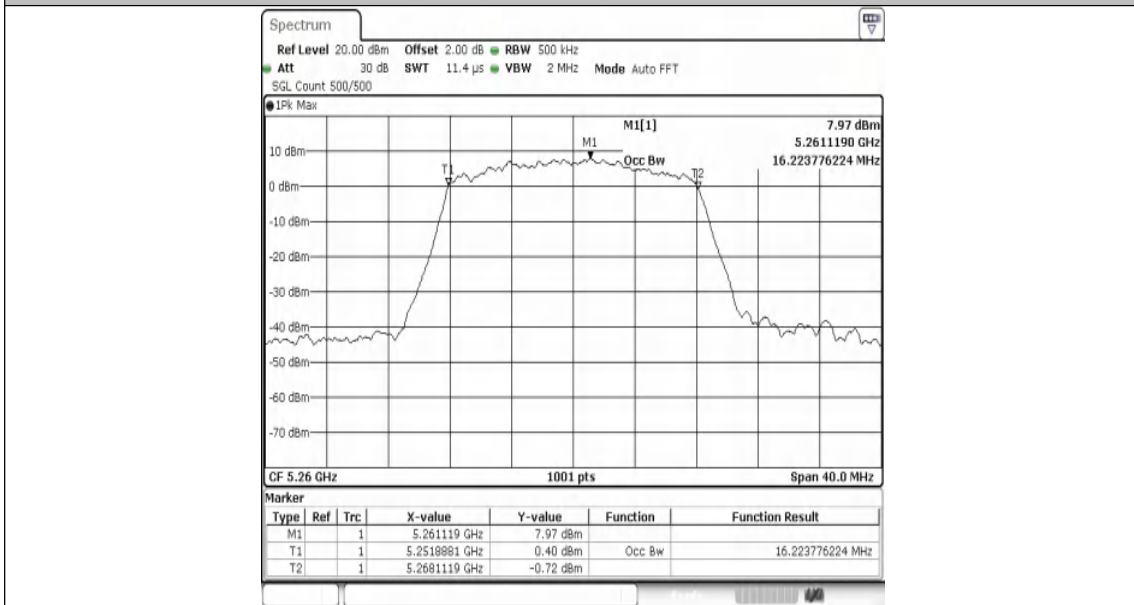


11A-Ant1-5260

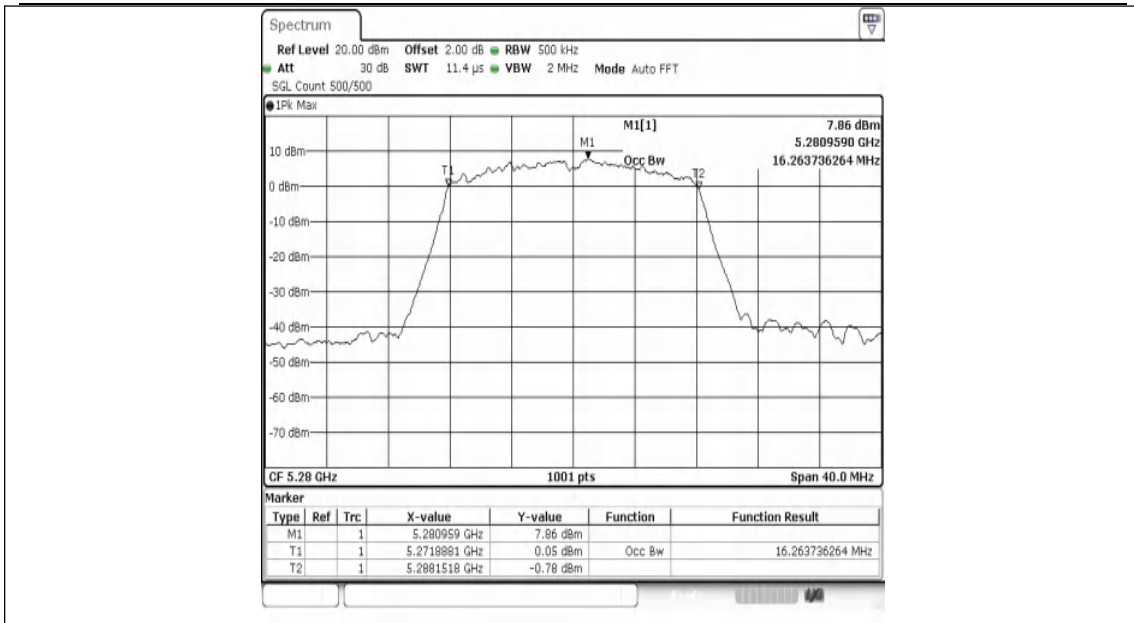



11A-Ant1-5280

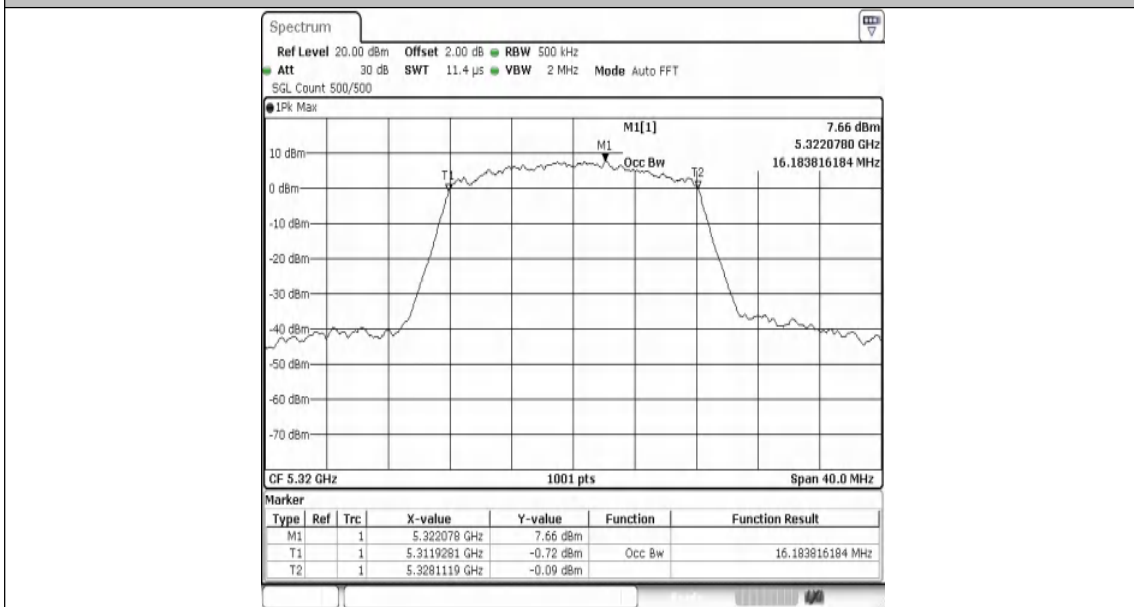


11A-Ant1-5320

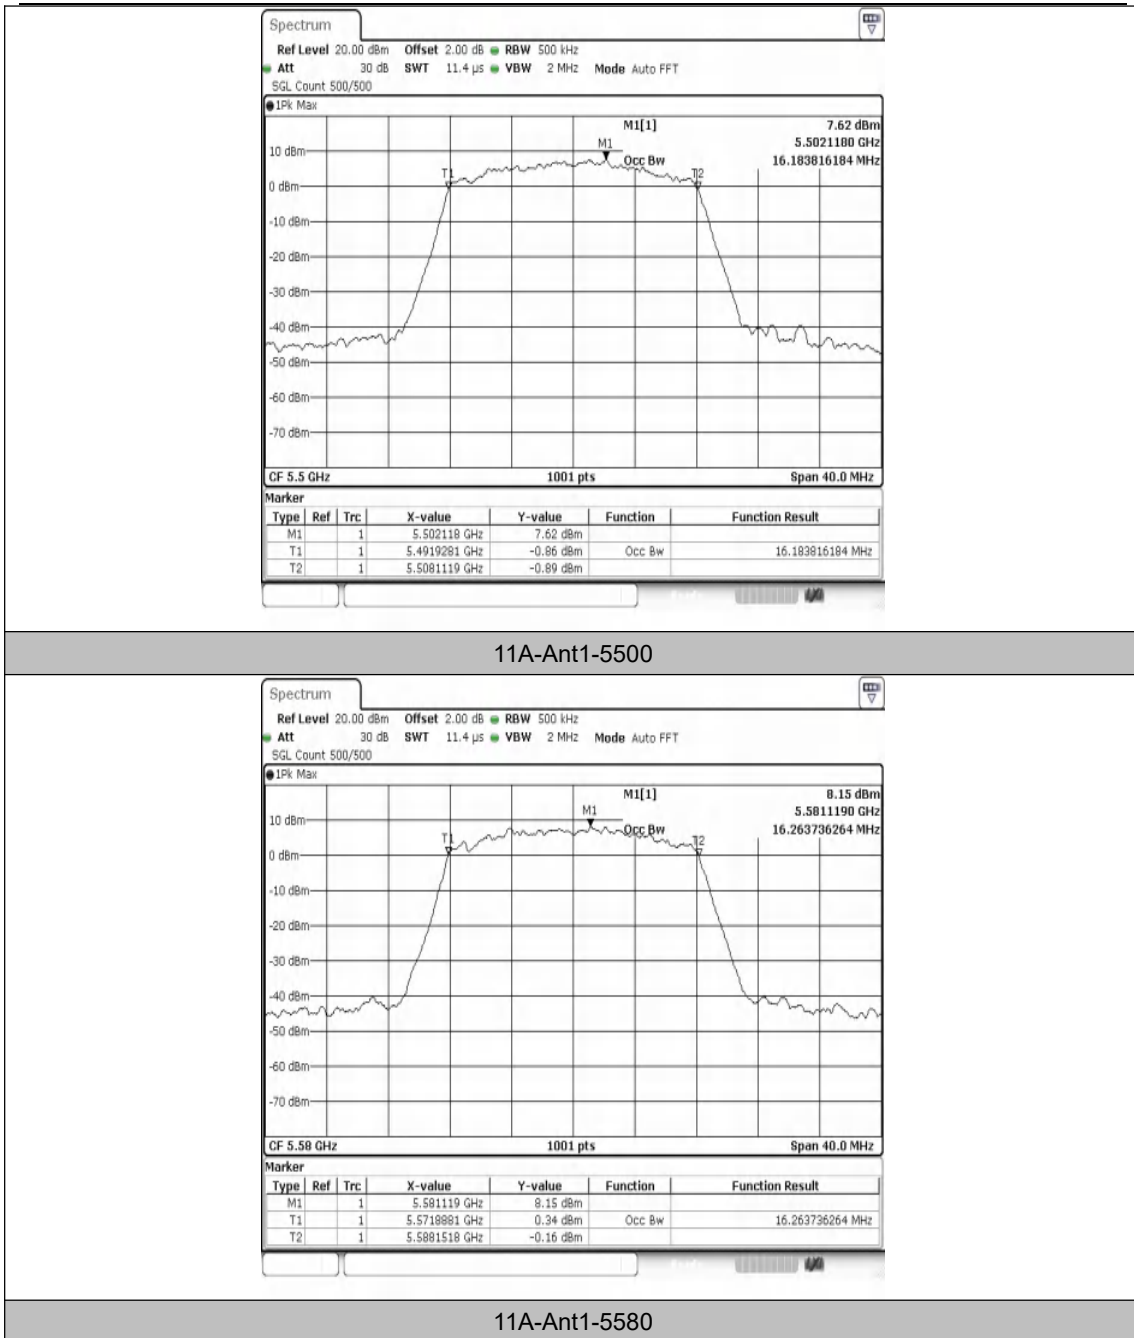

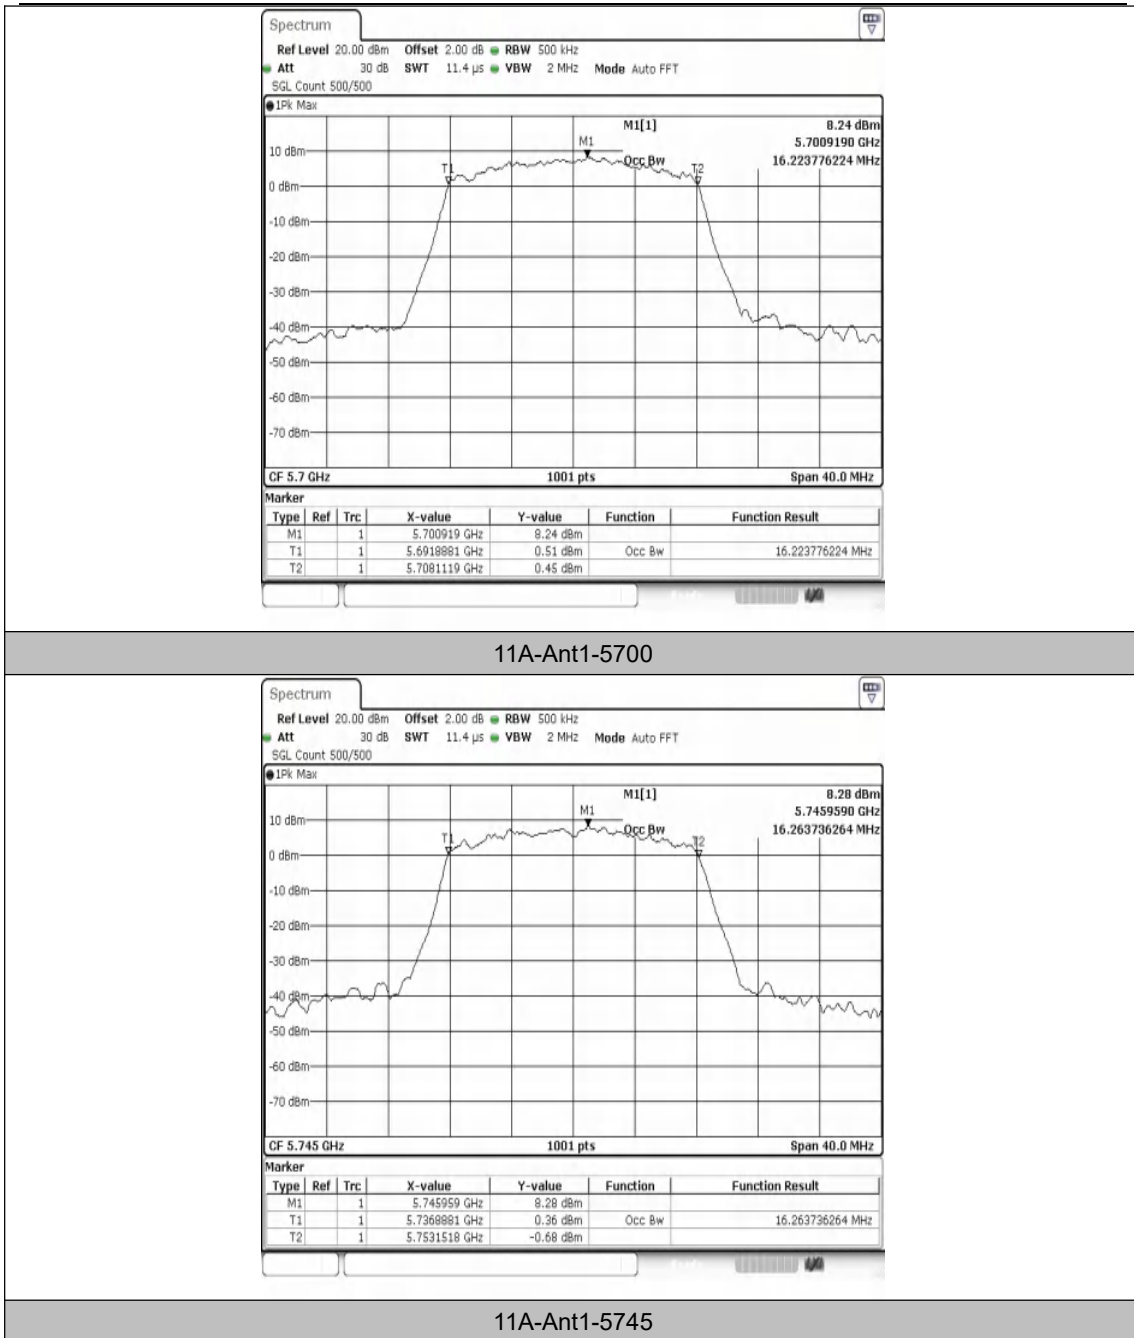


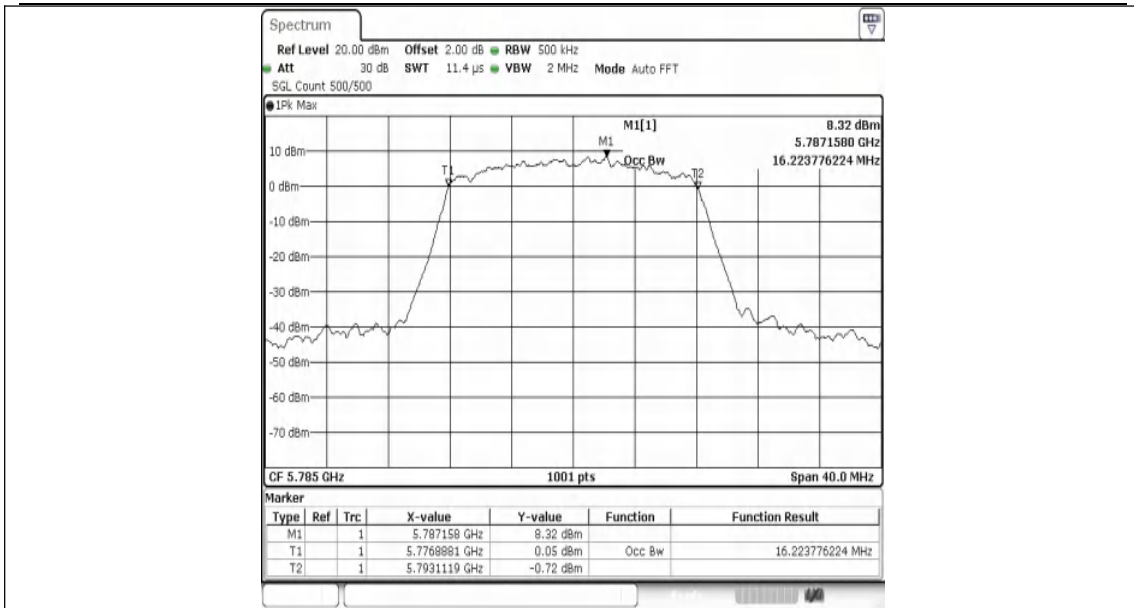



11A-Ant1-5785

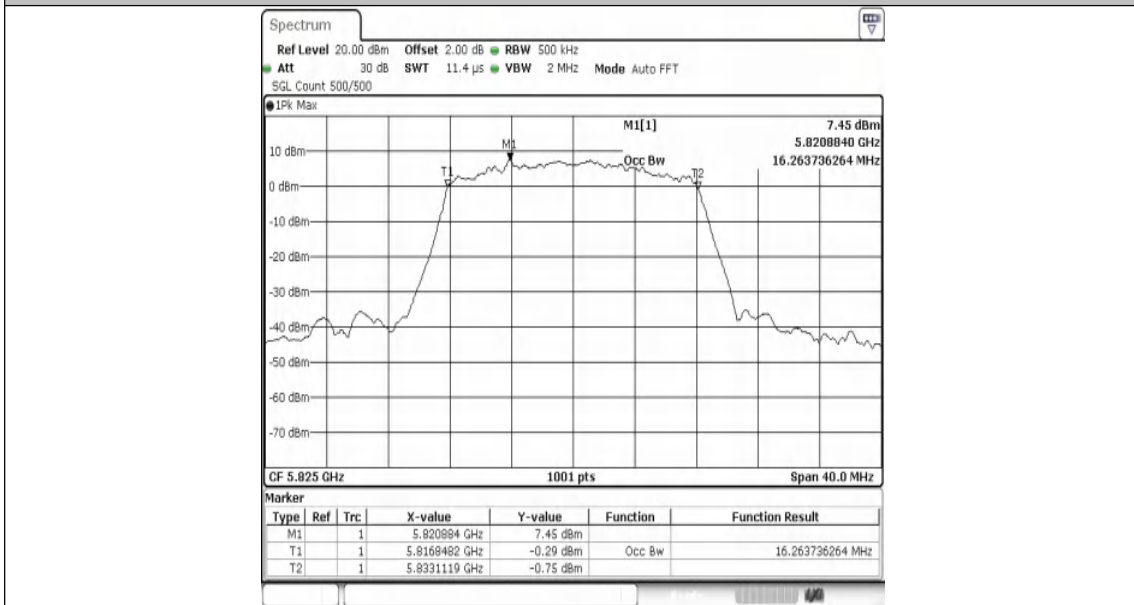



11A-Ant1-5825

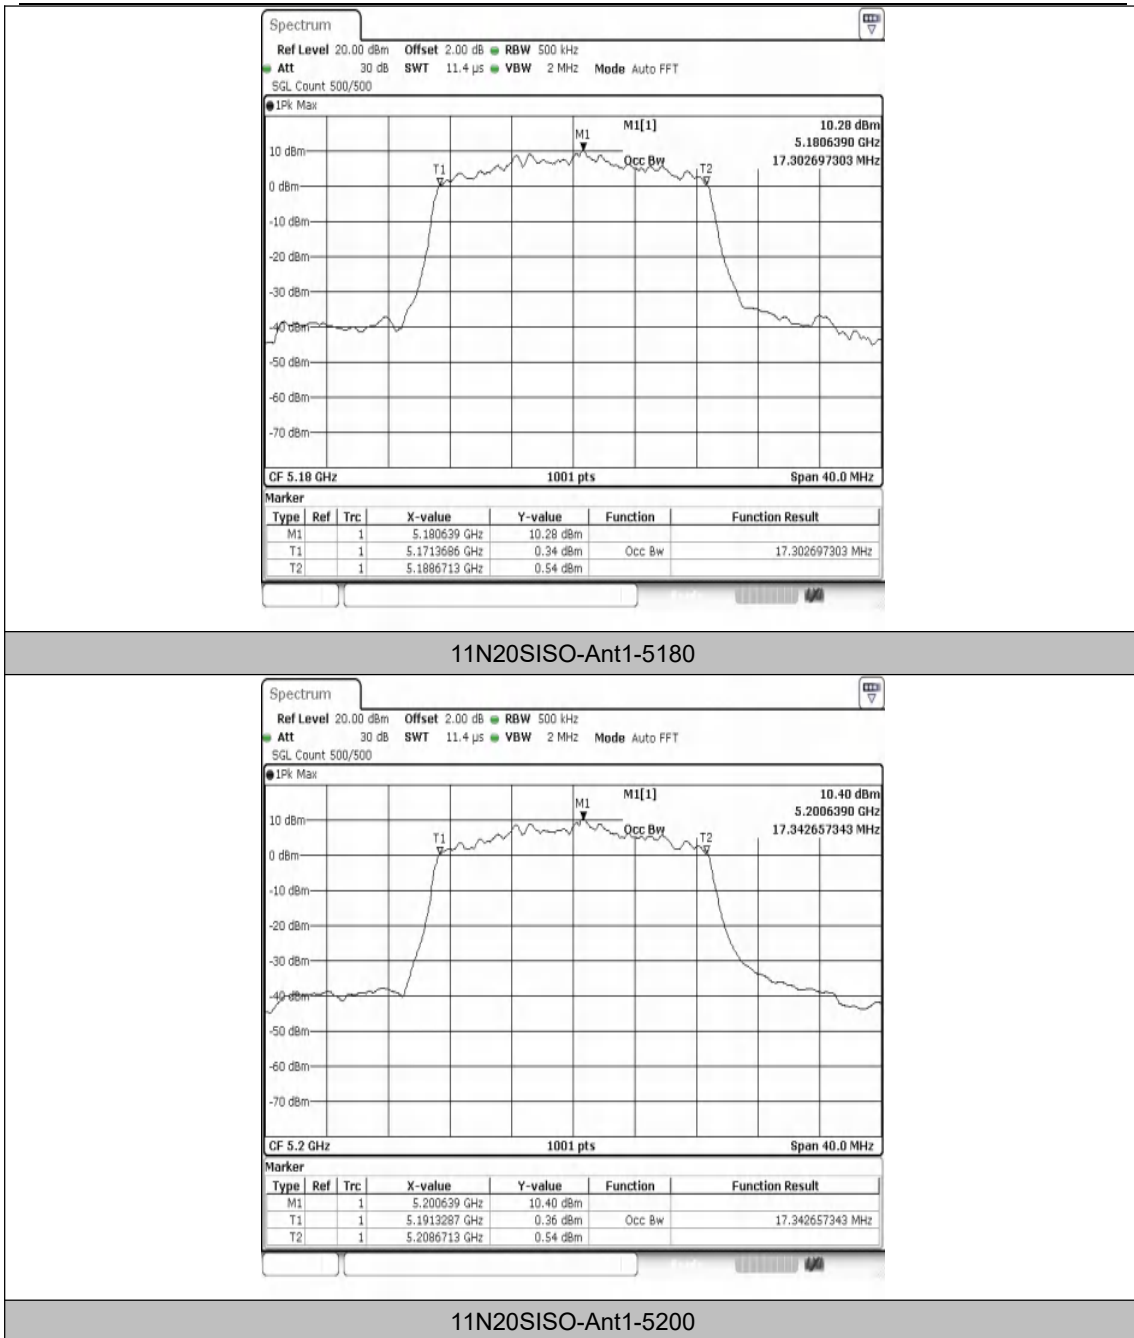


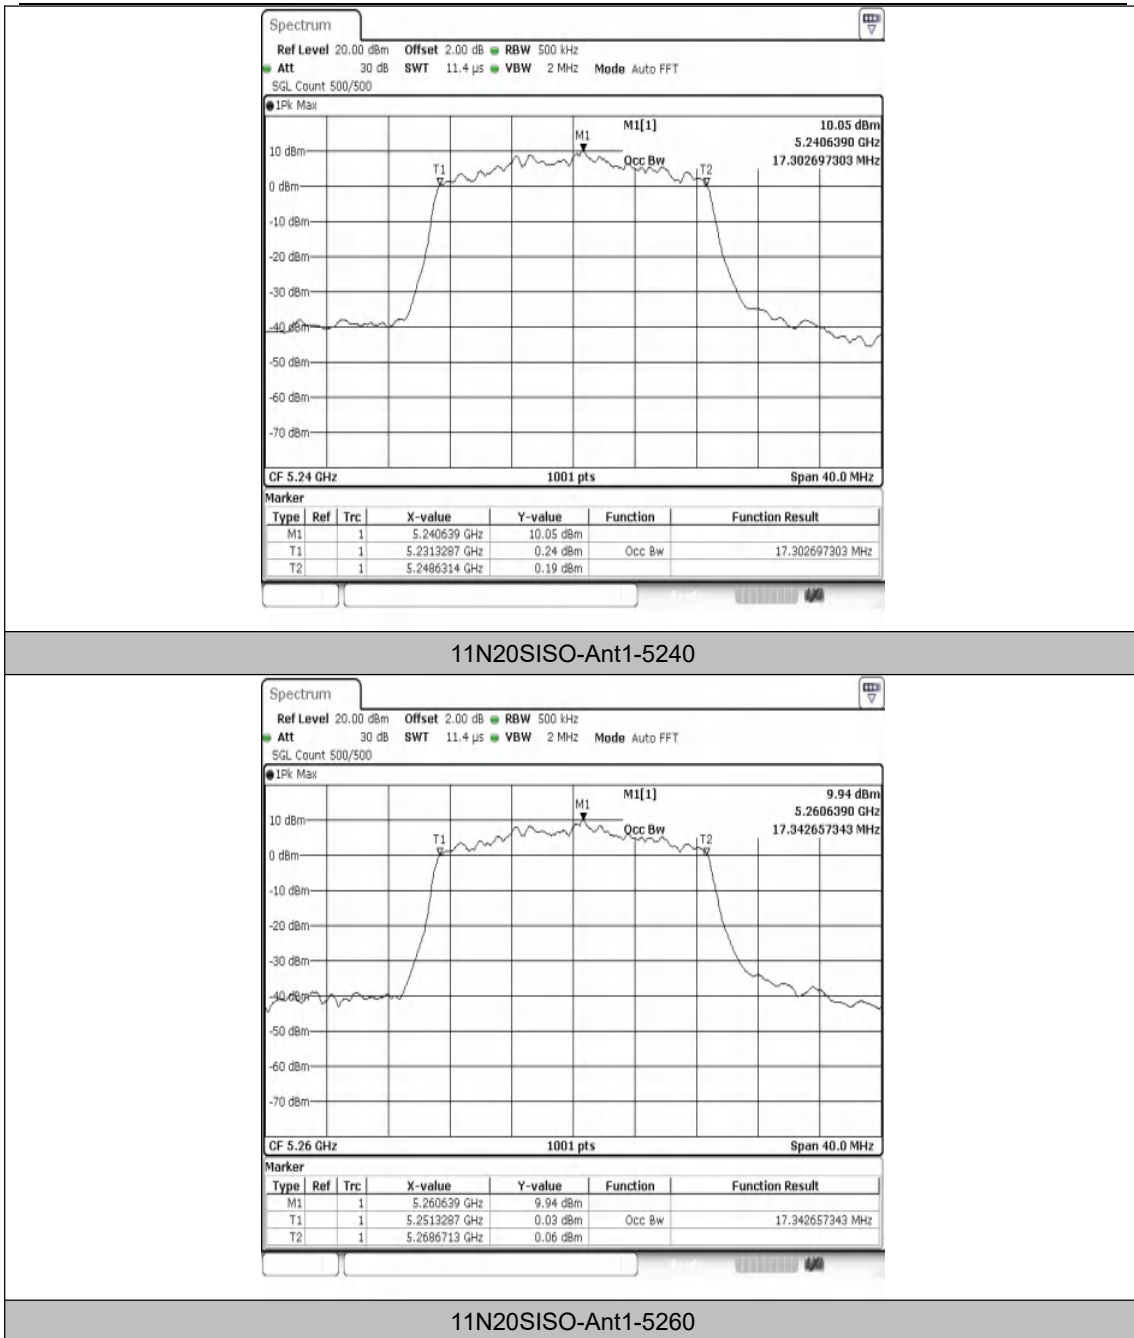


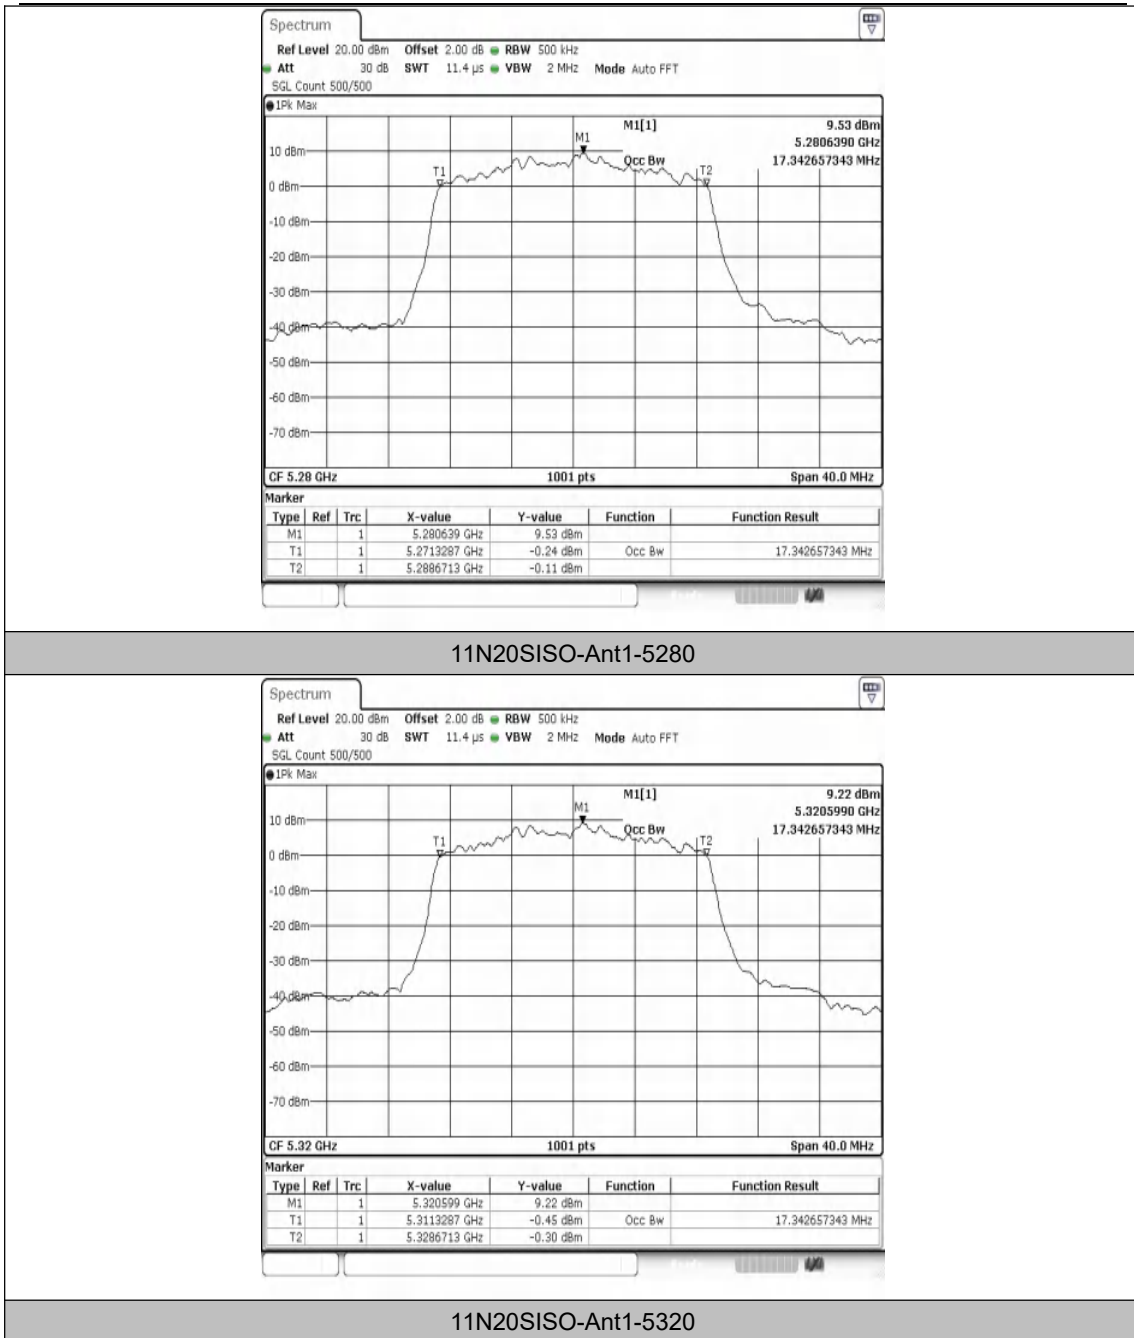


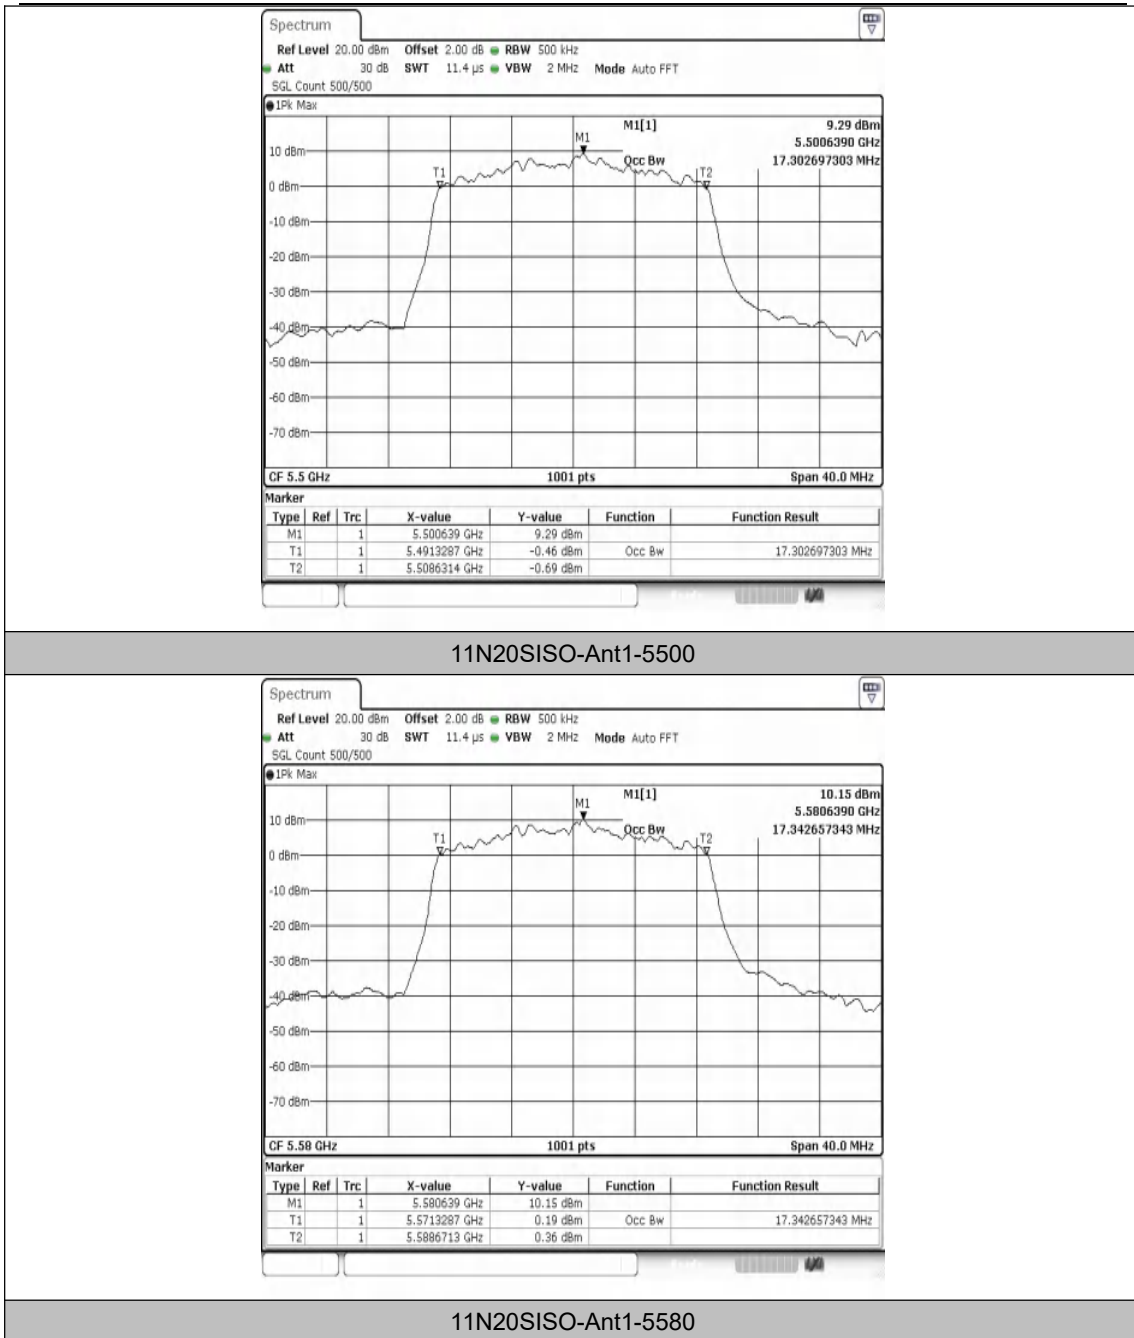


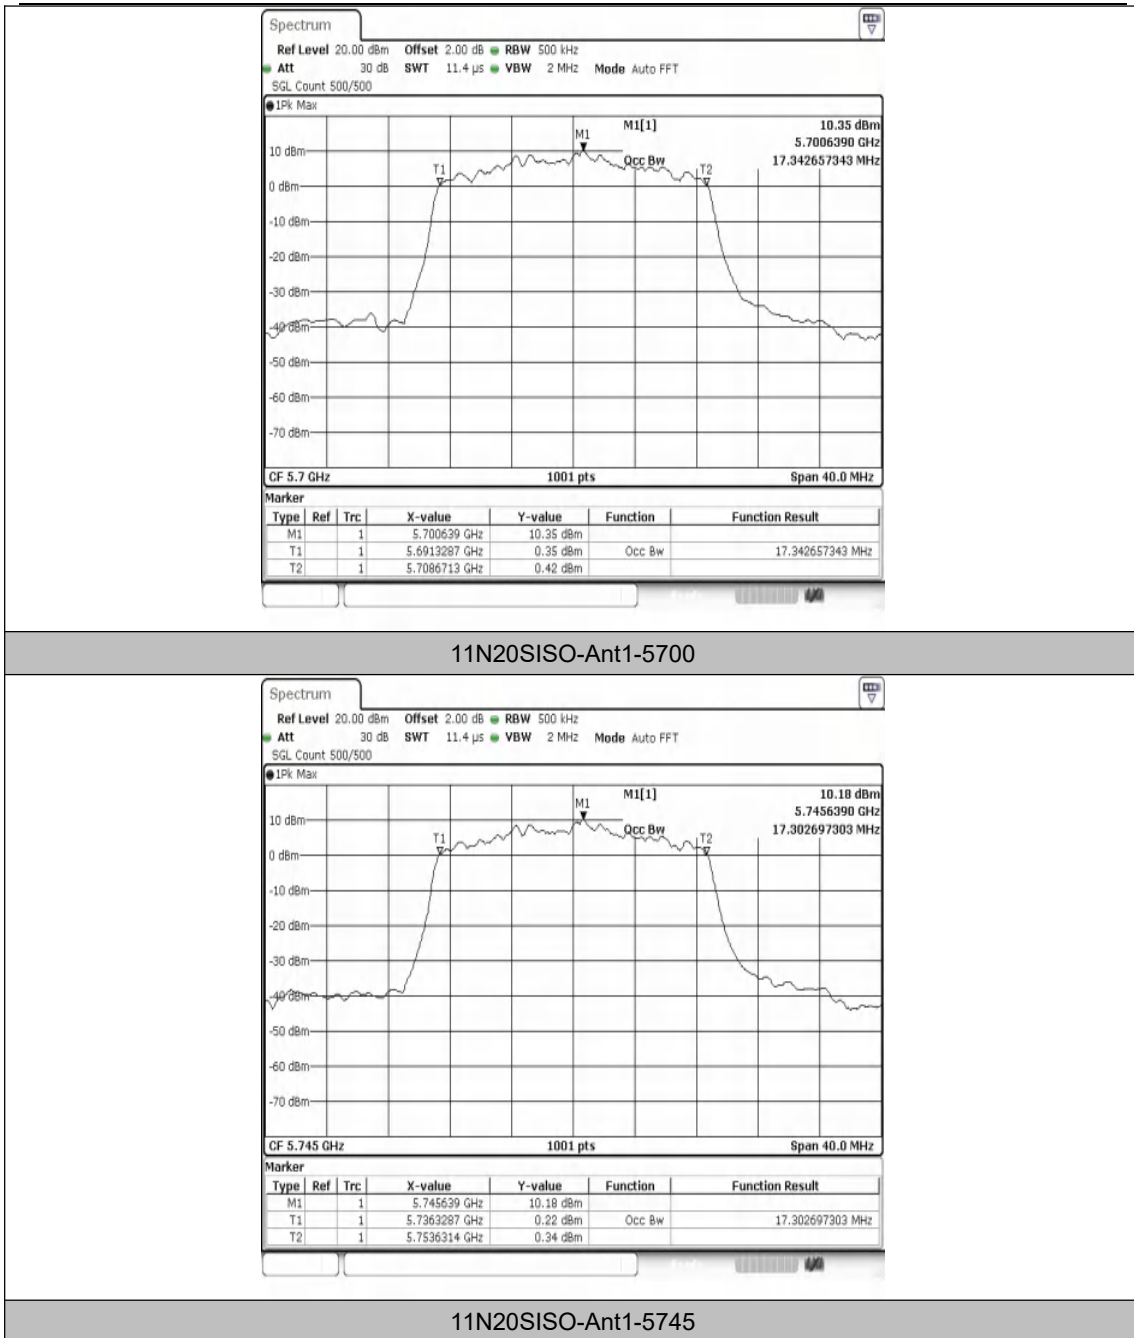

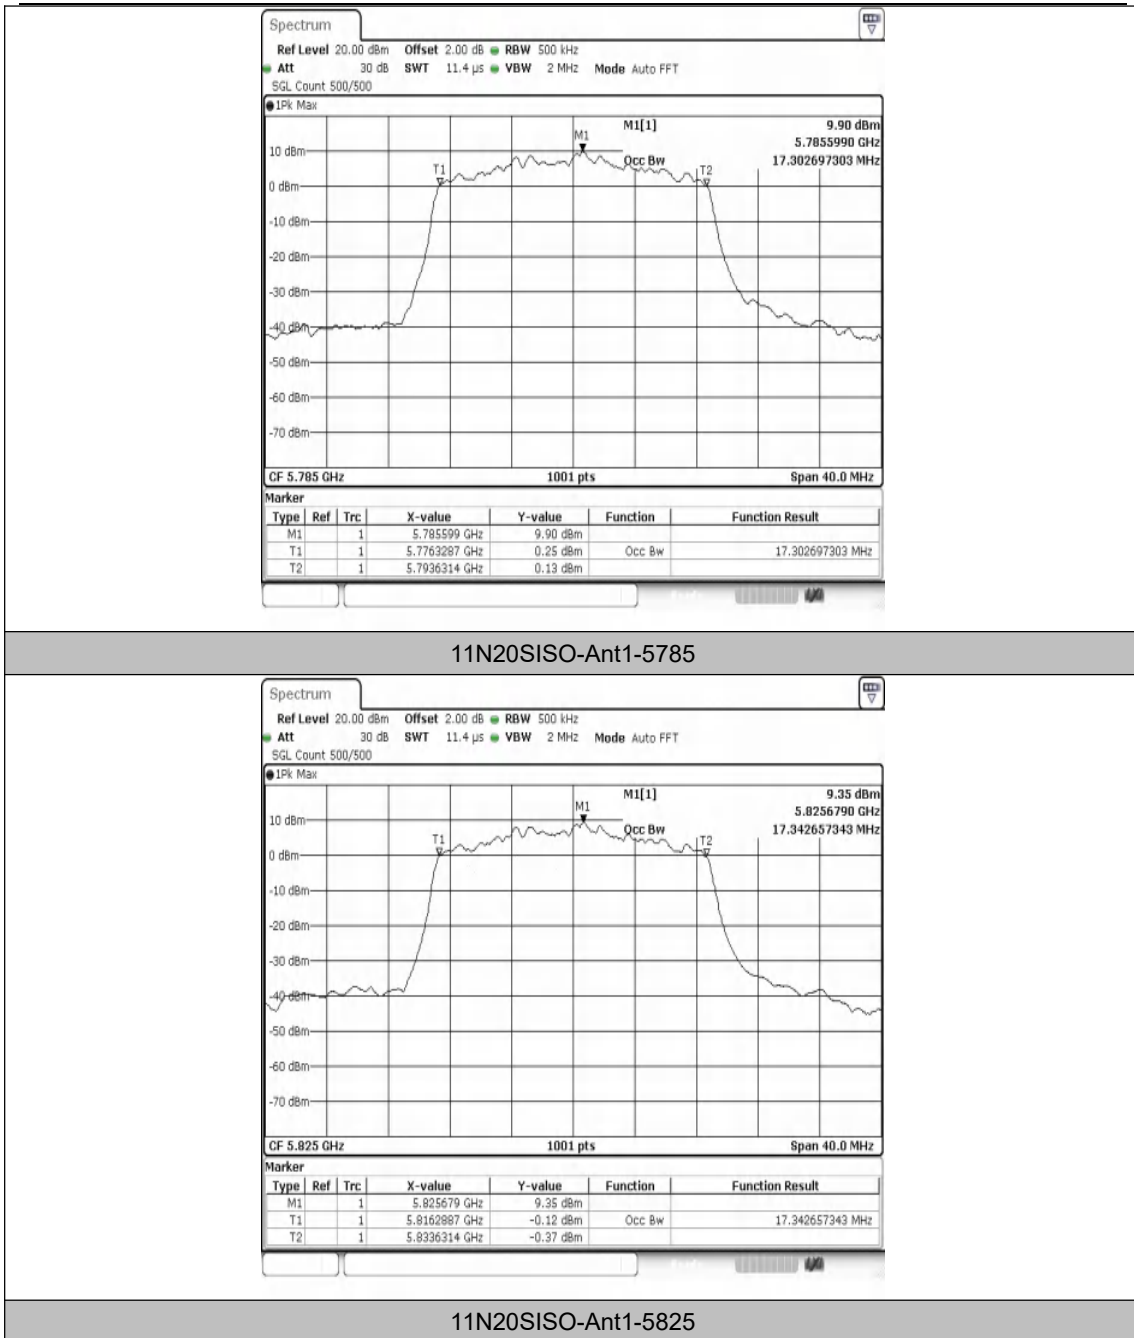

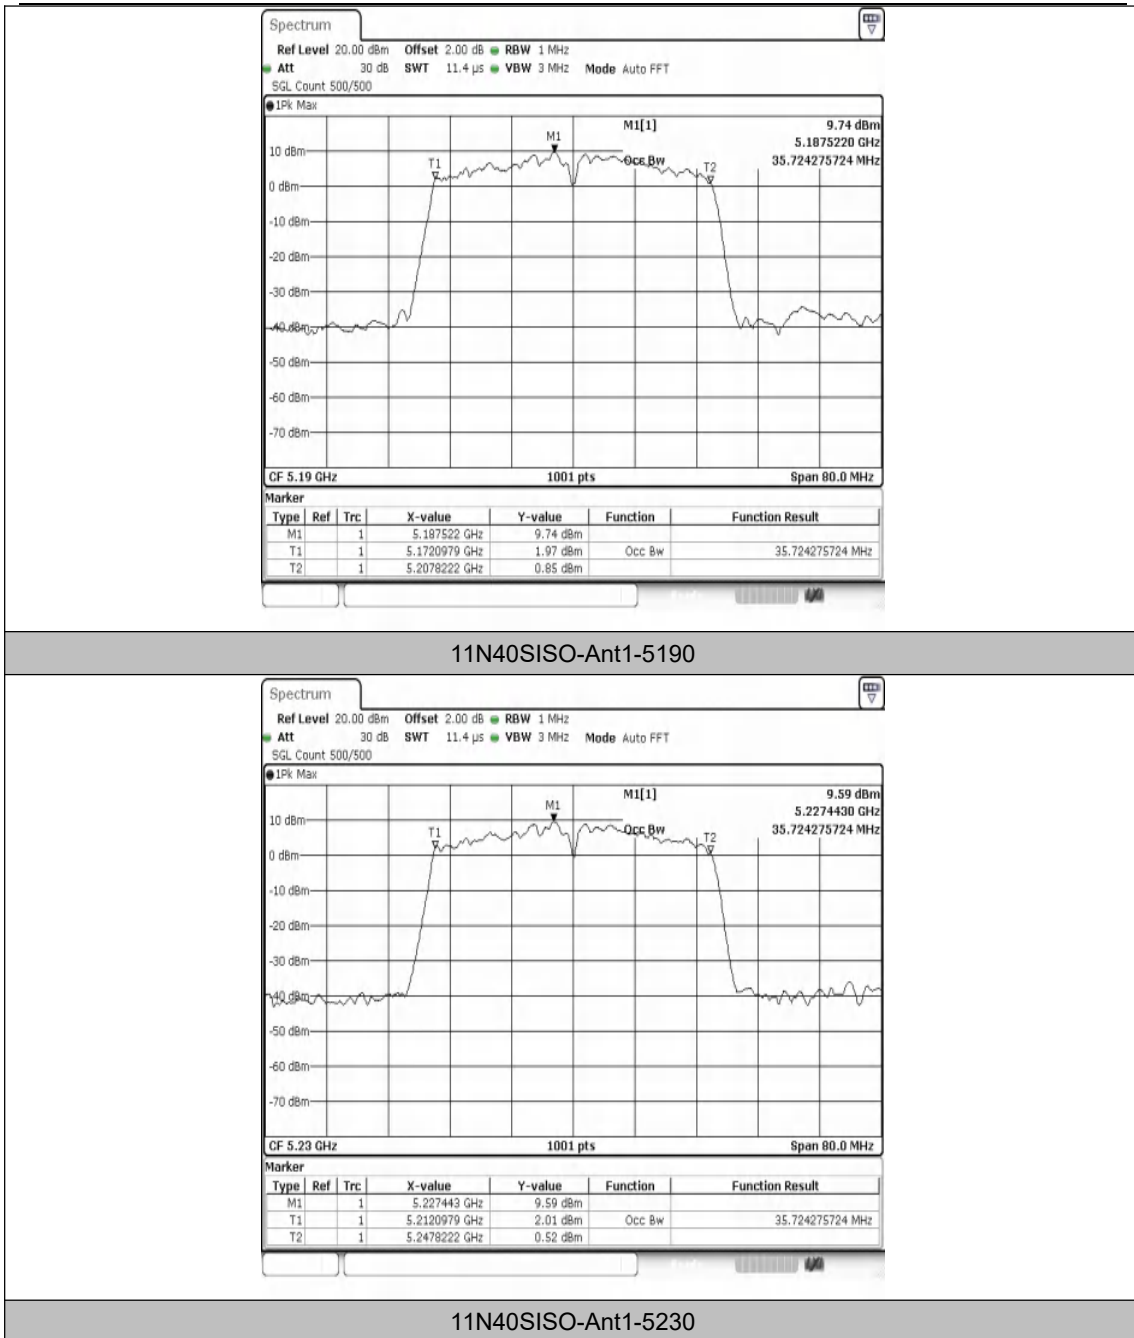

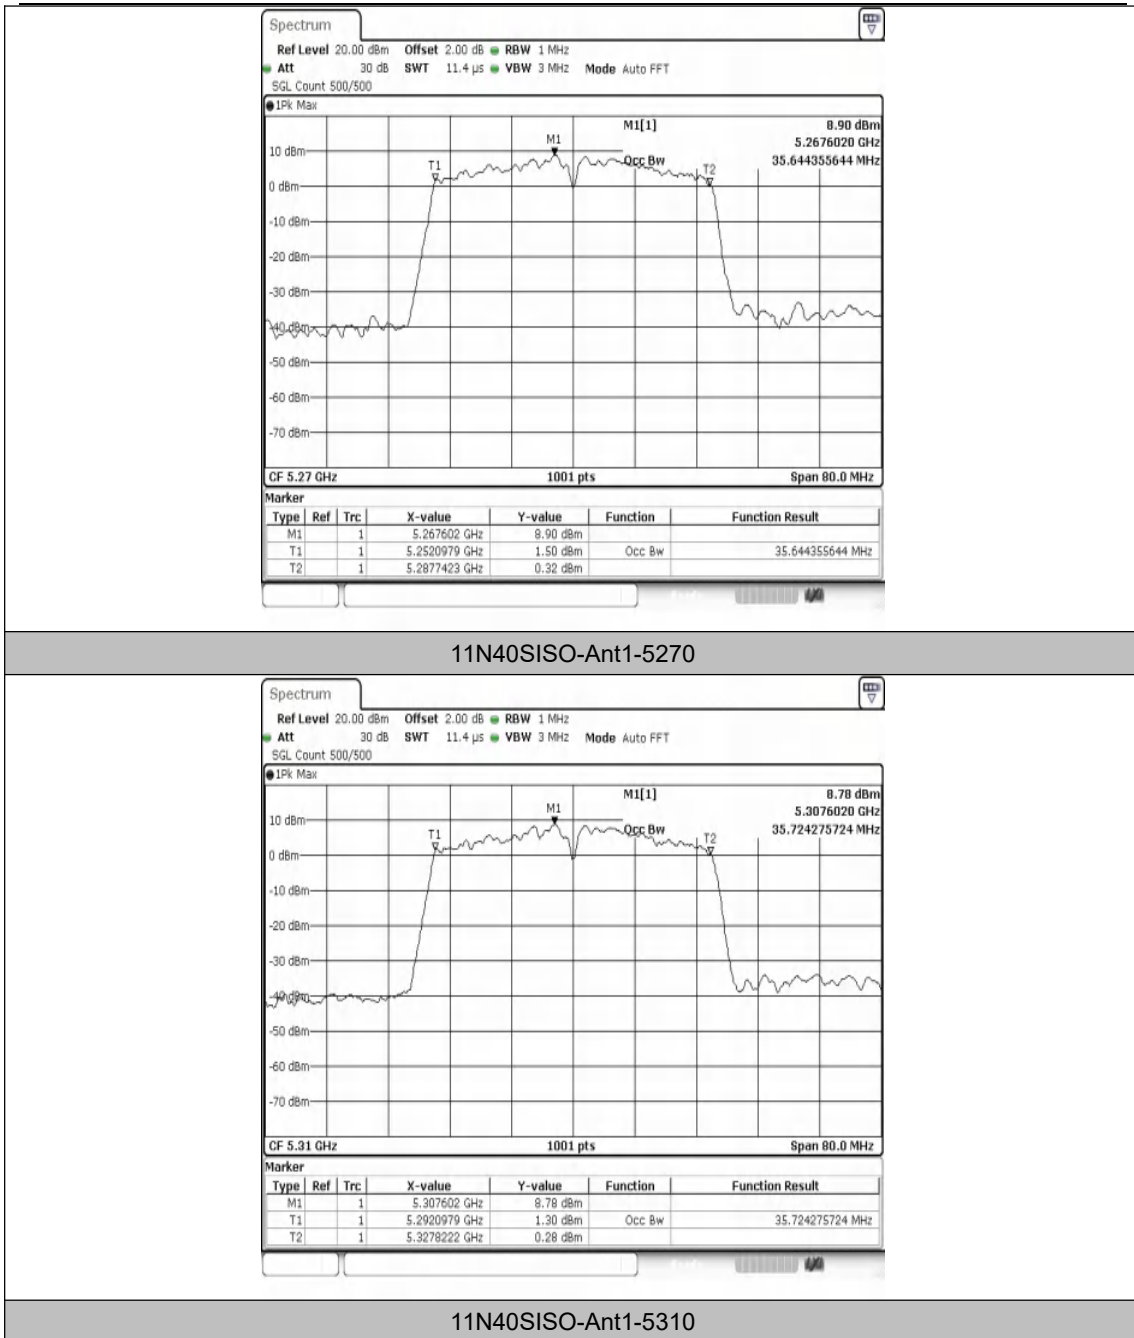


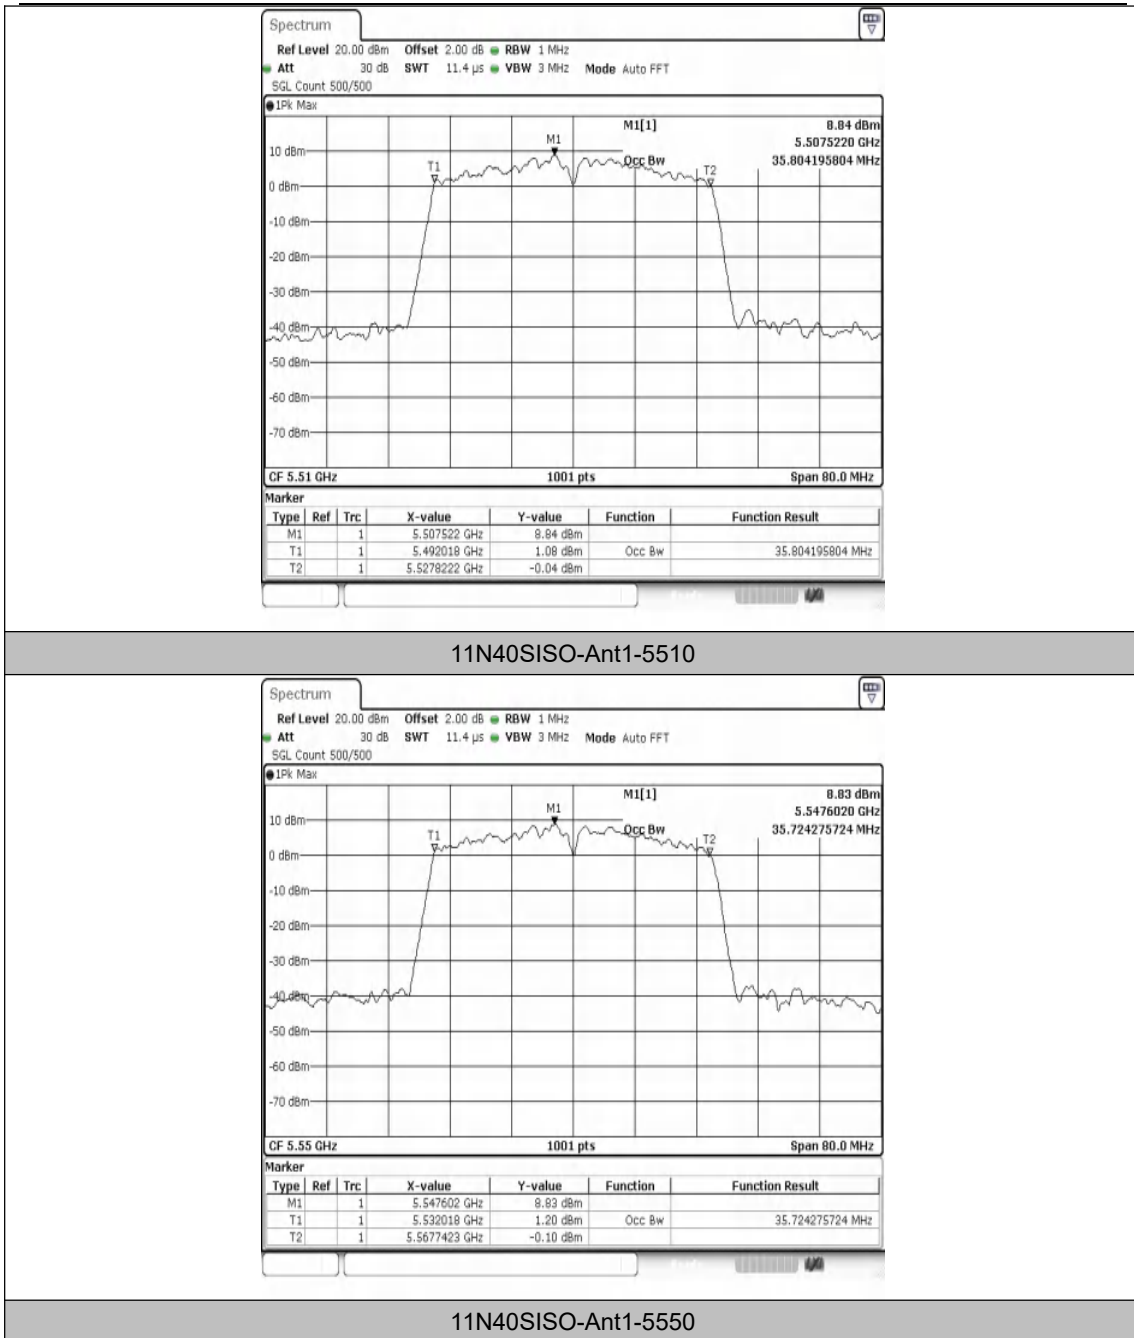



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

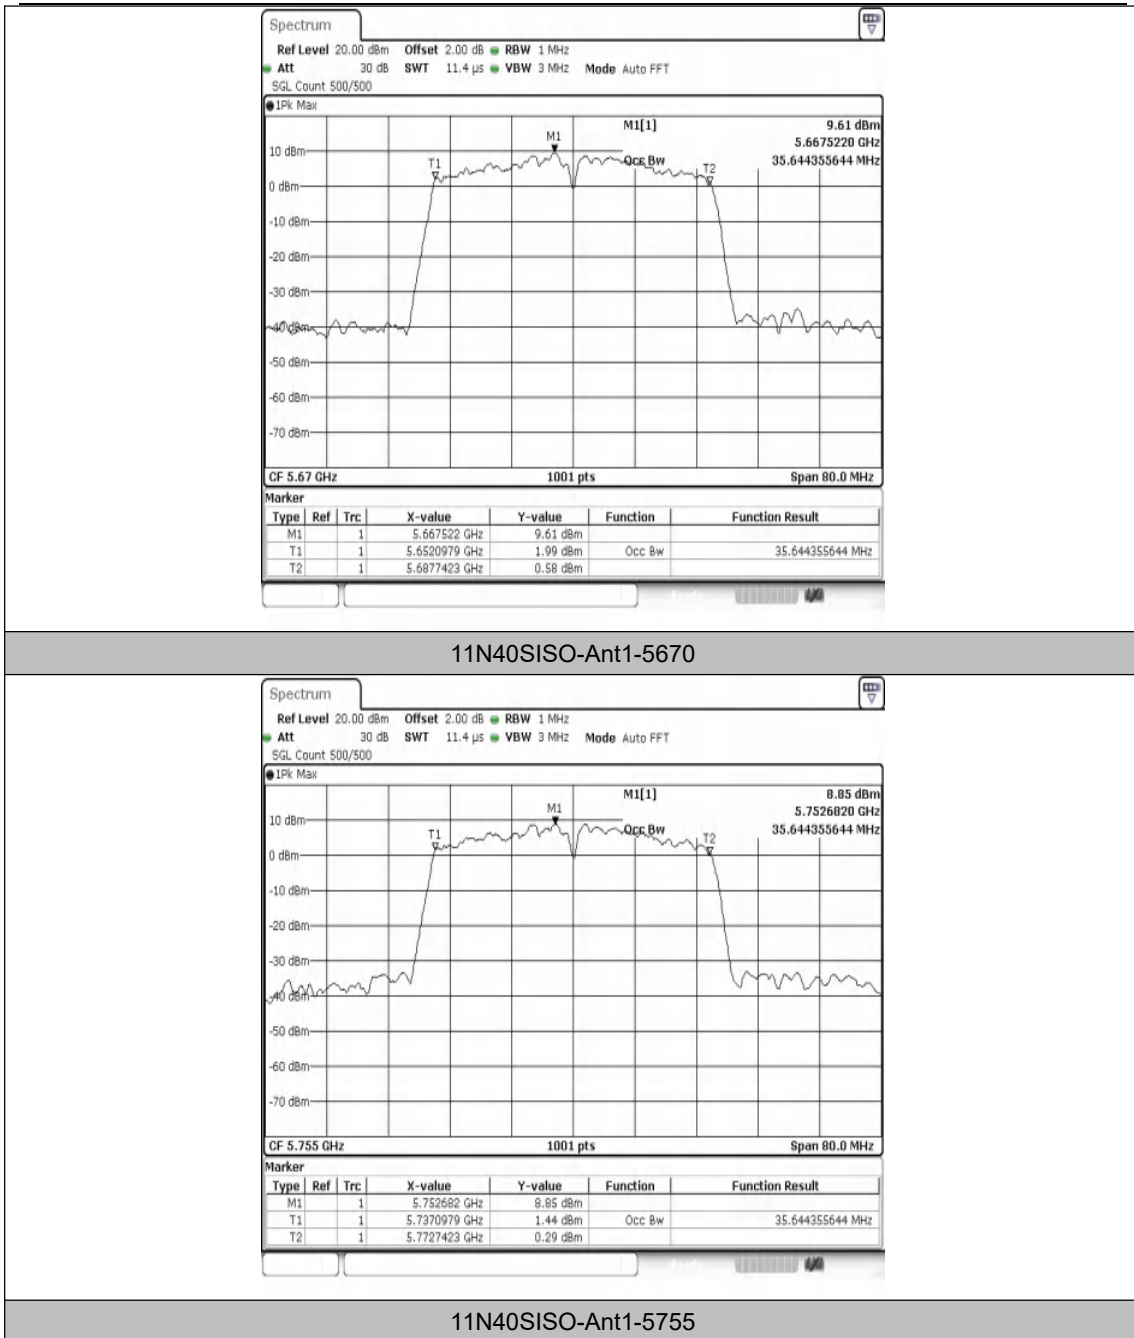

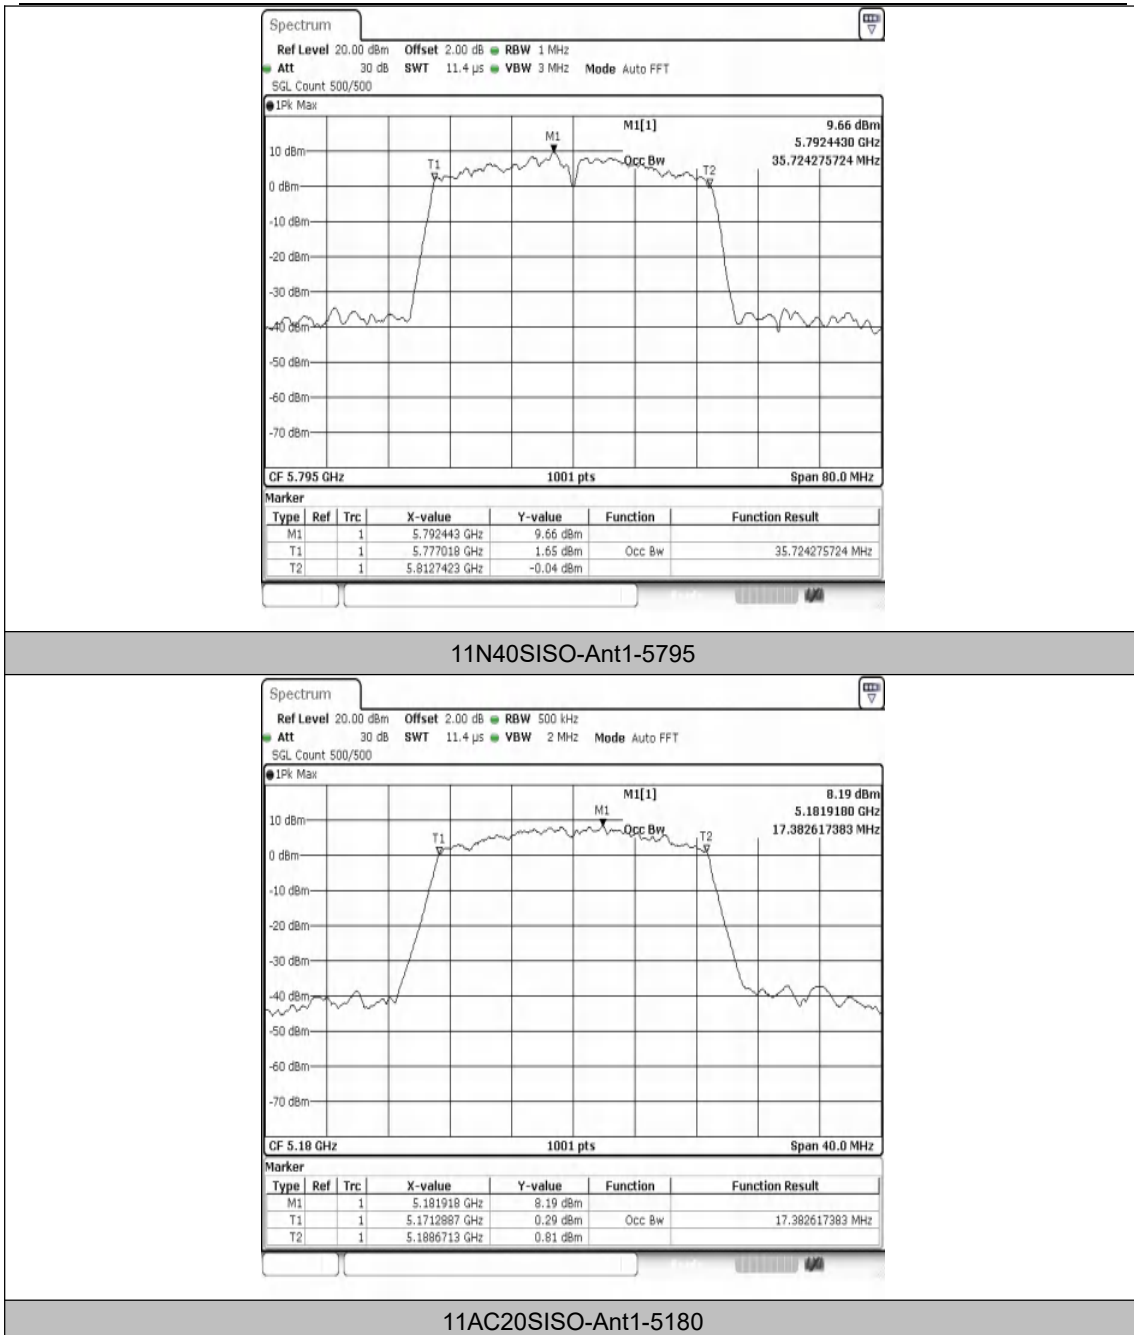


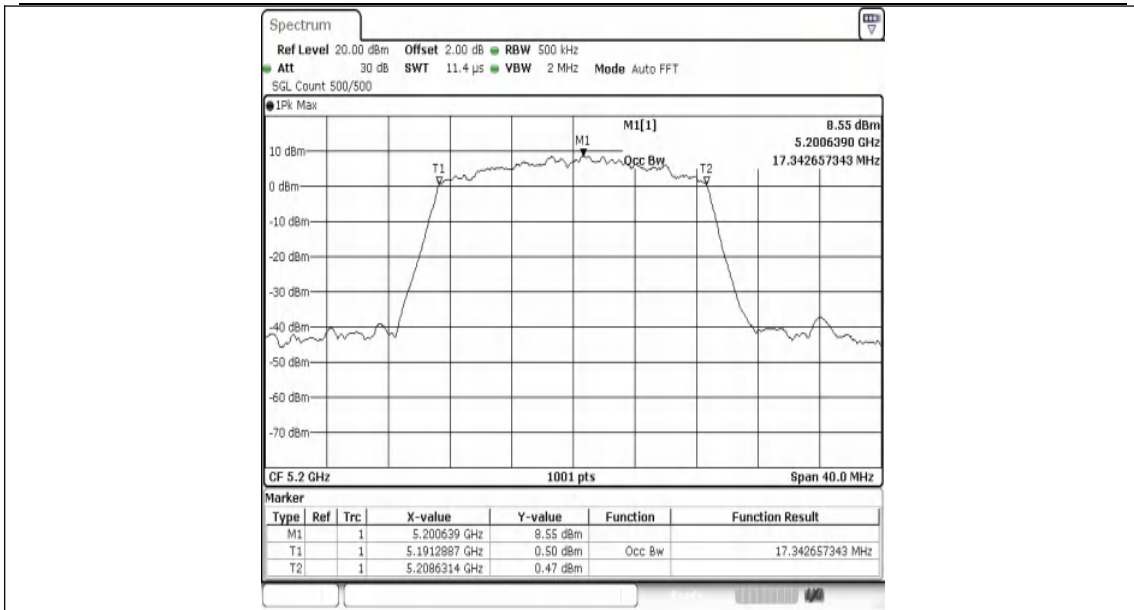


11AC20SISO-Ant1-5200

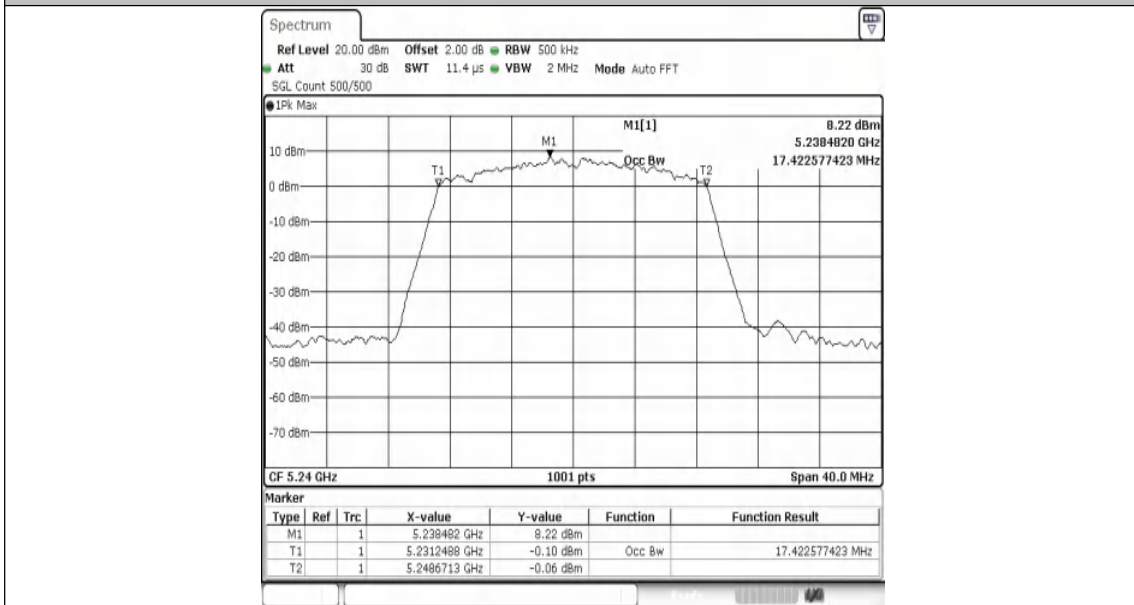


11AC20SISO-Ant1-5240

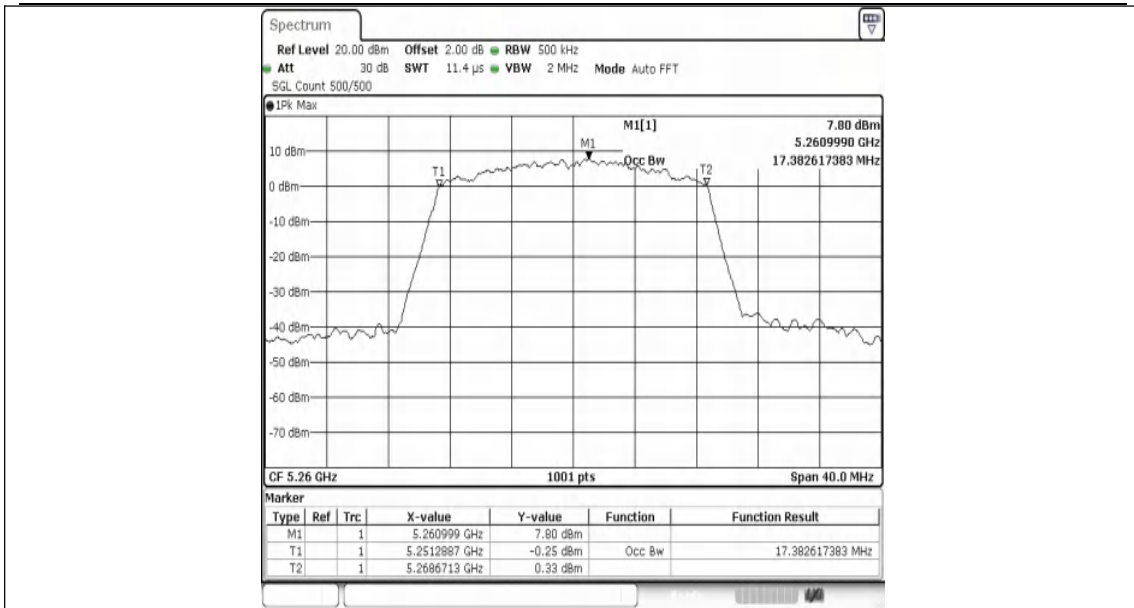



11AC20SISO-Ant1-5260

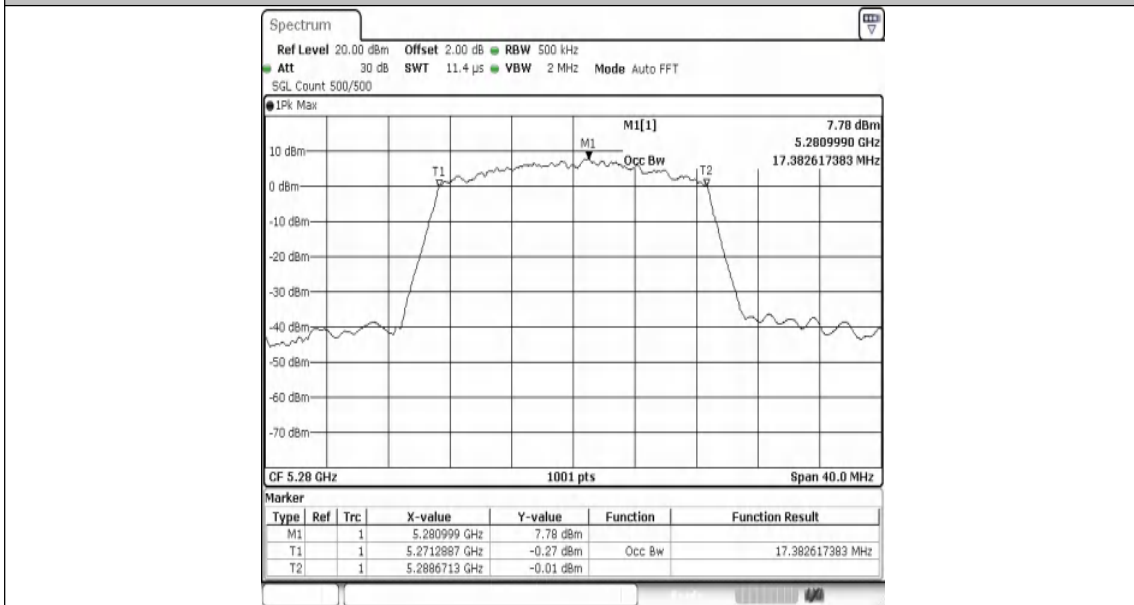


11AC20SISO-Ant1-5280

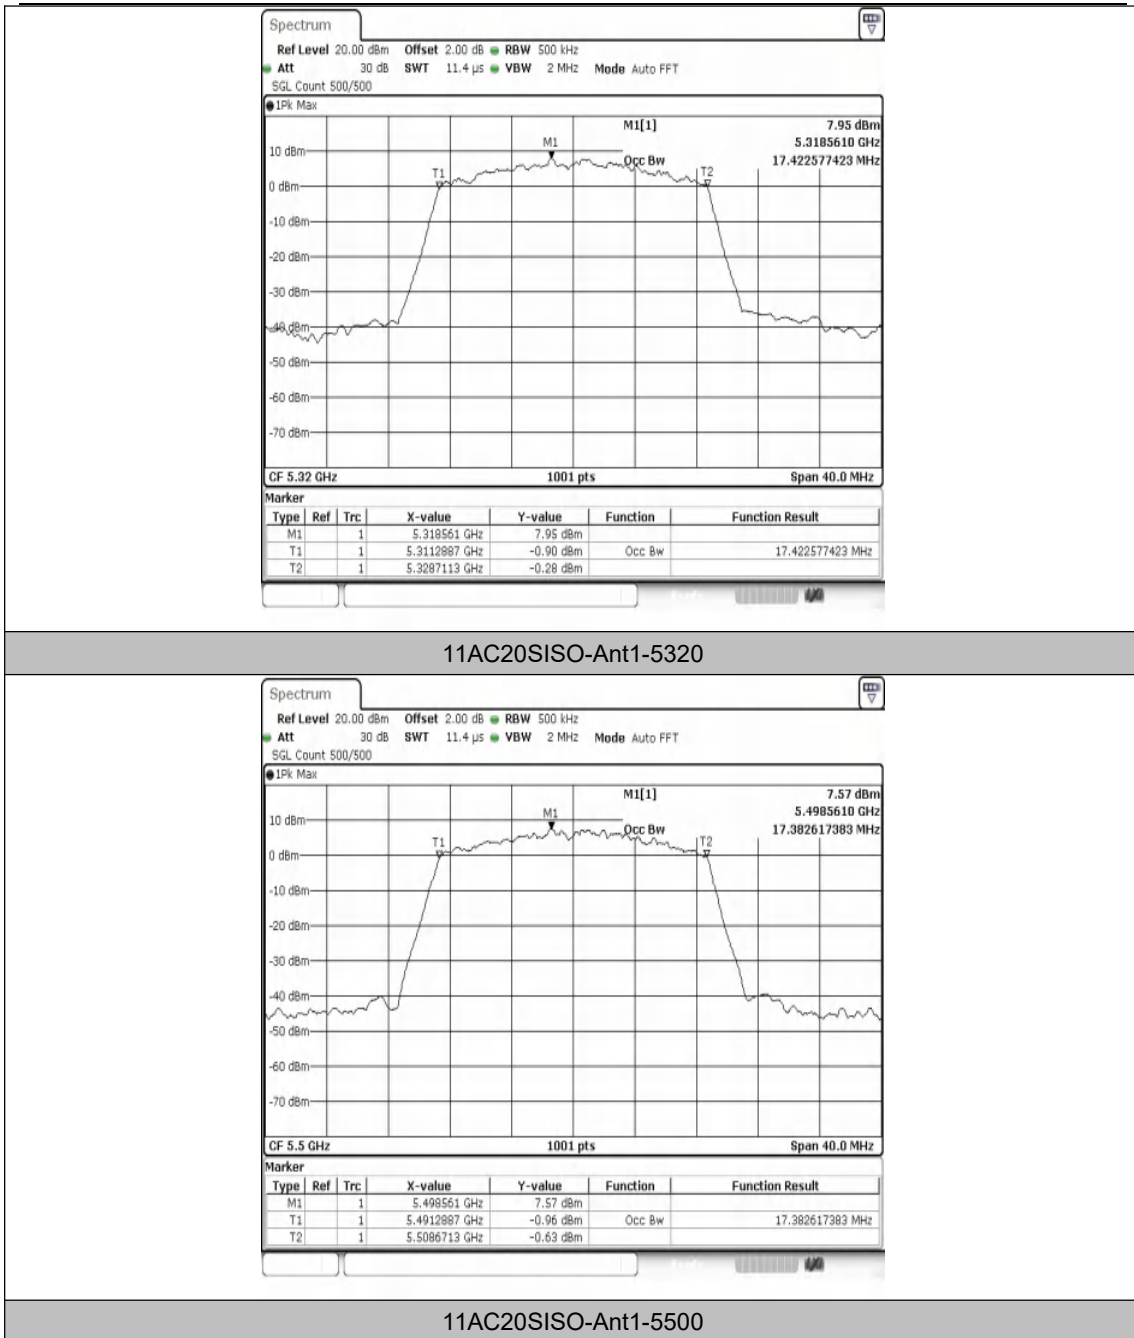

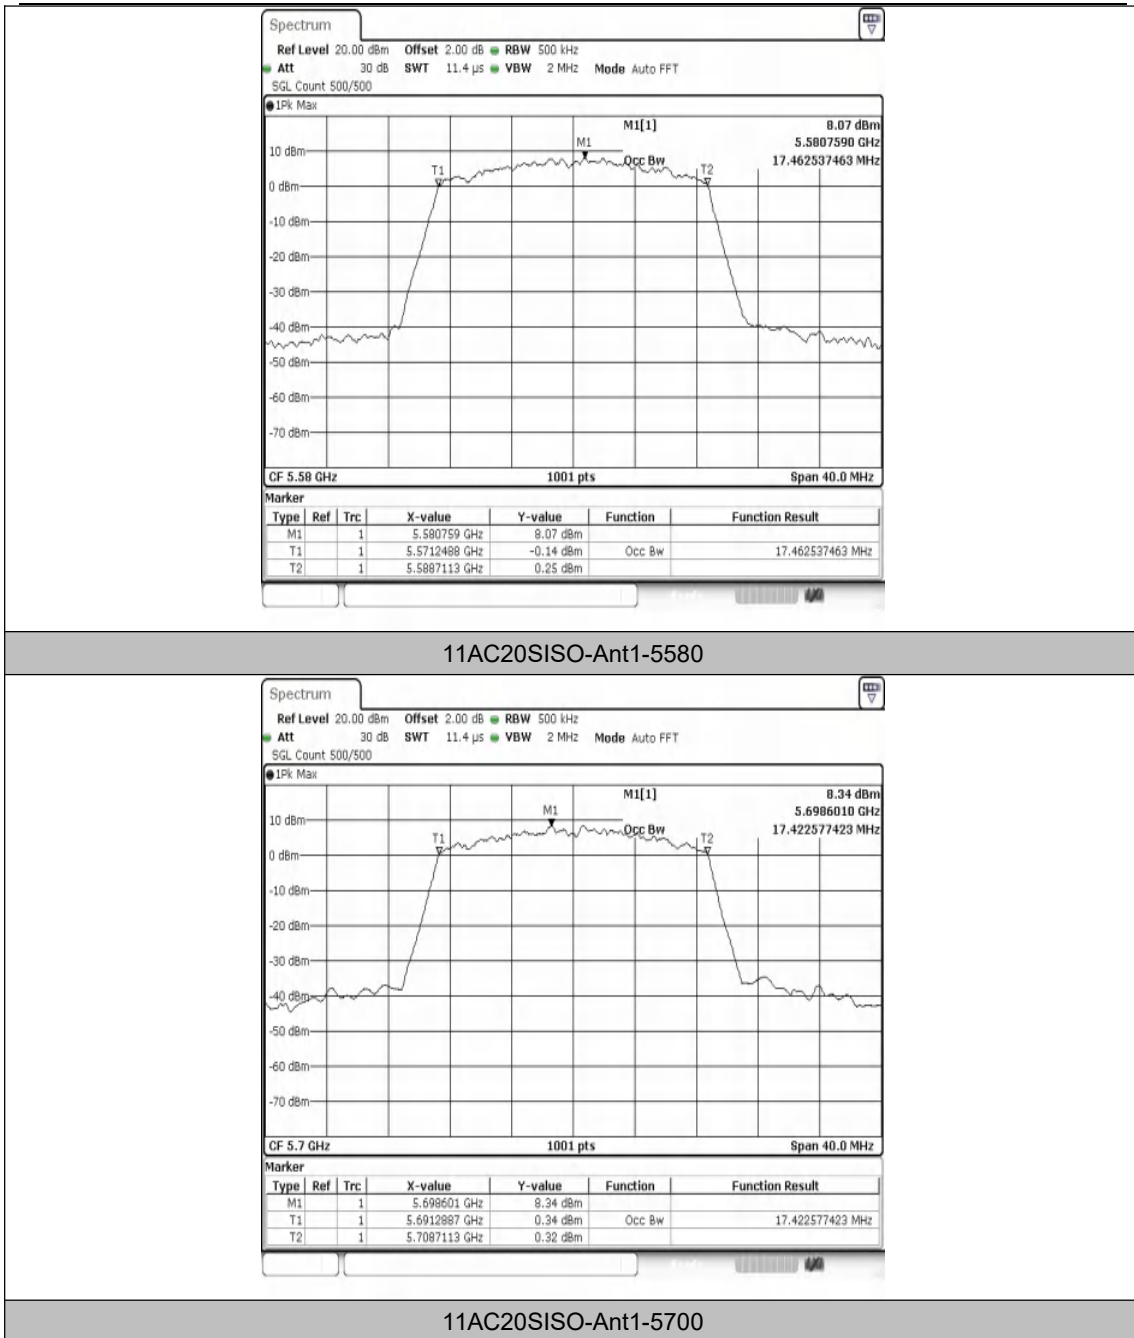

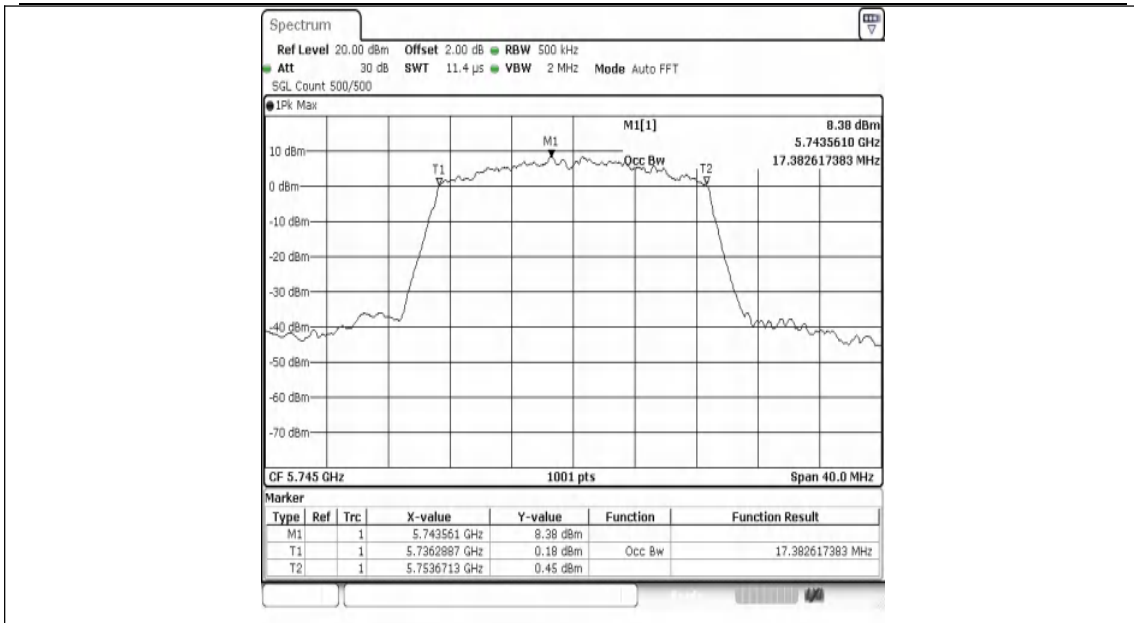

11AC20SISO-Ant1-5745

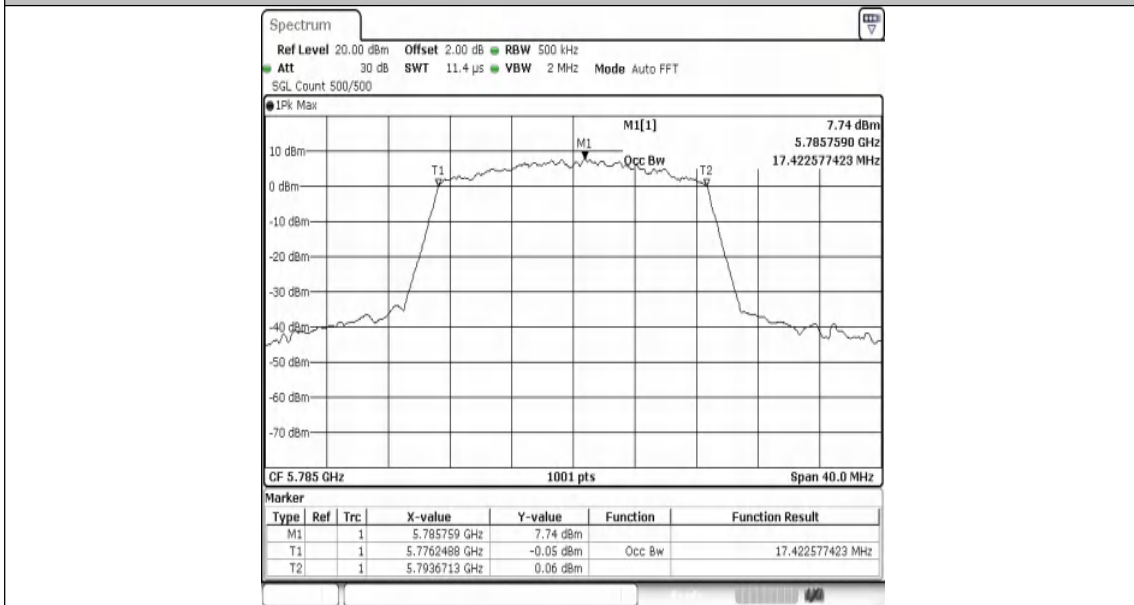



11AC20SISO-Ant1-5785

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

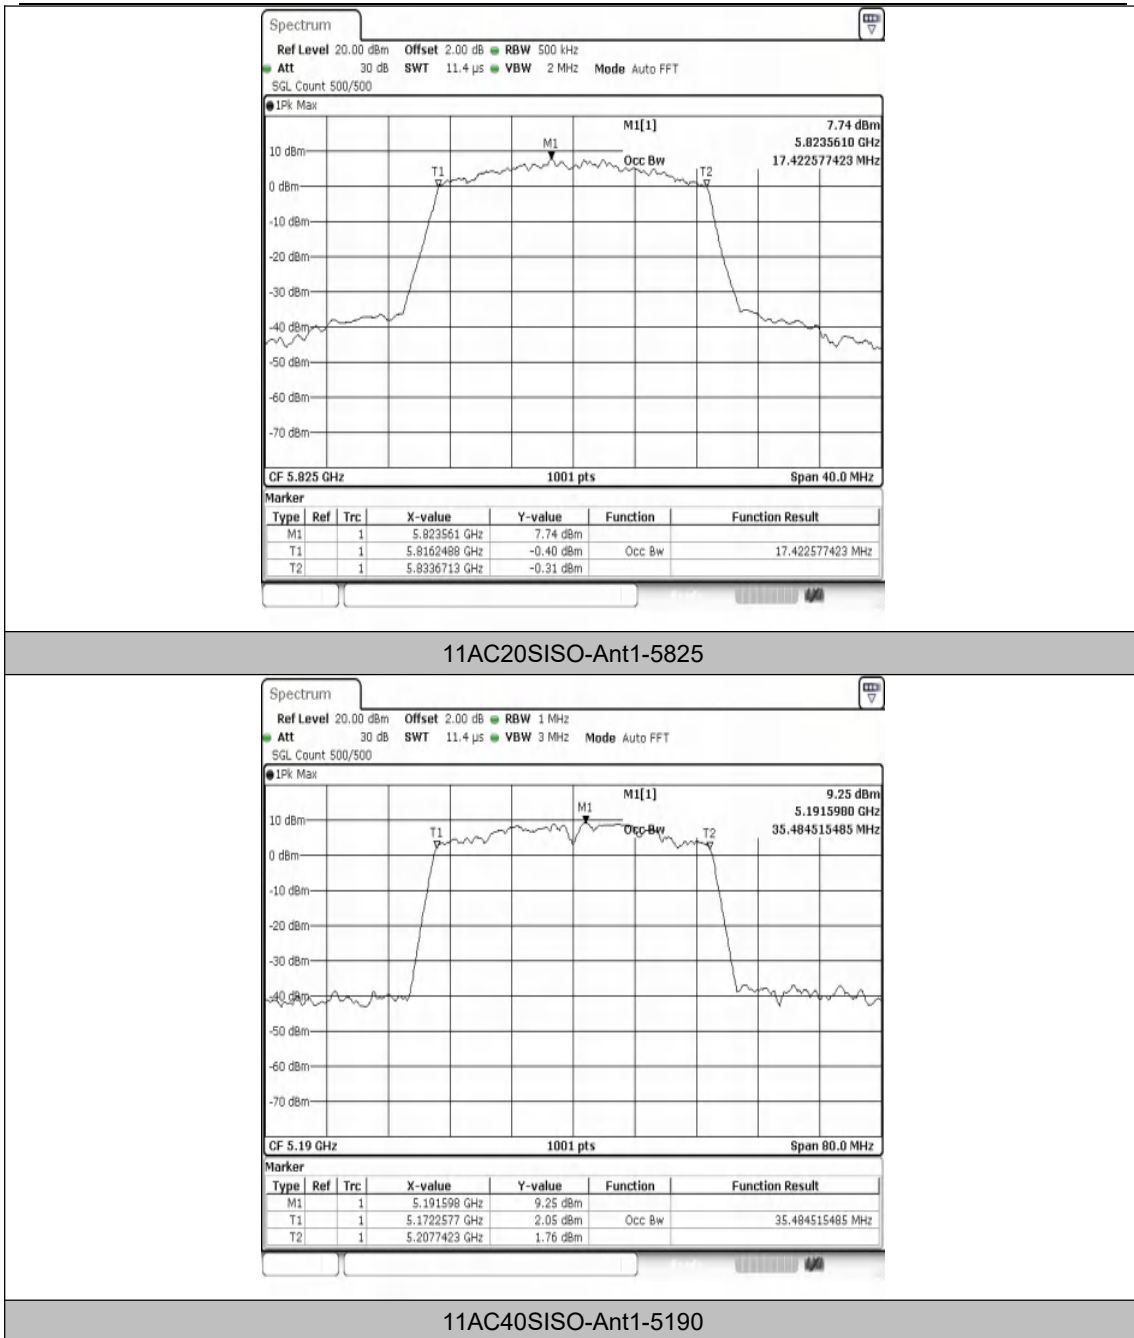


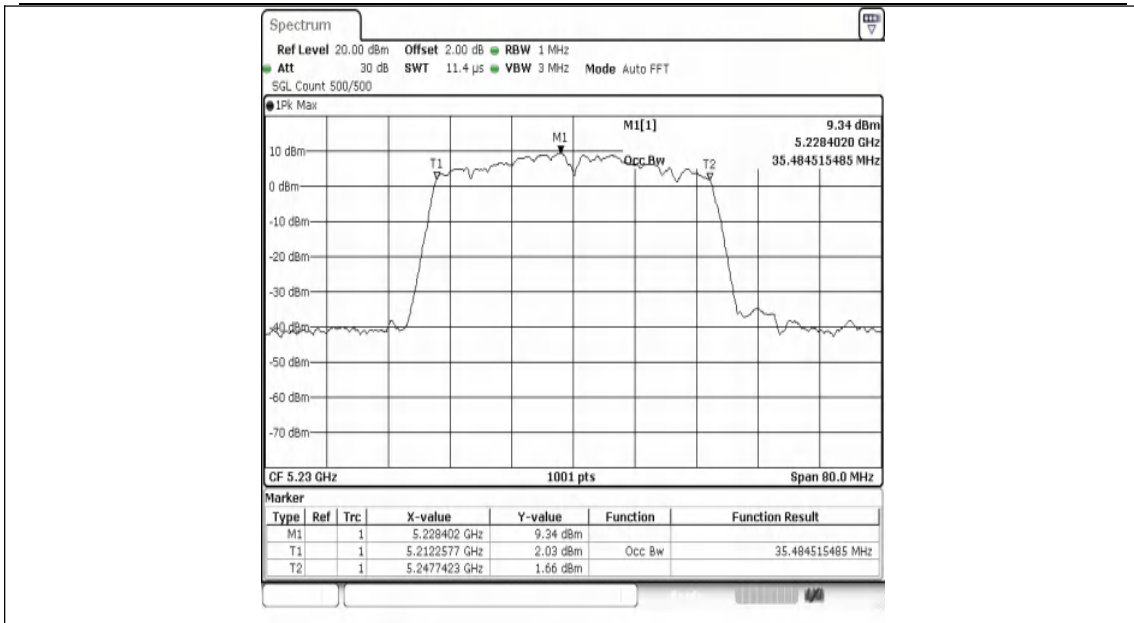


11AC40SISO-Ant1-5230

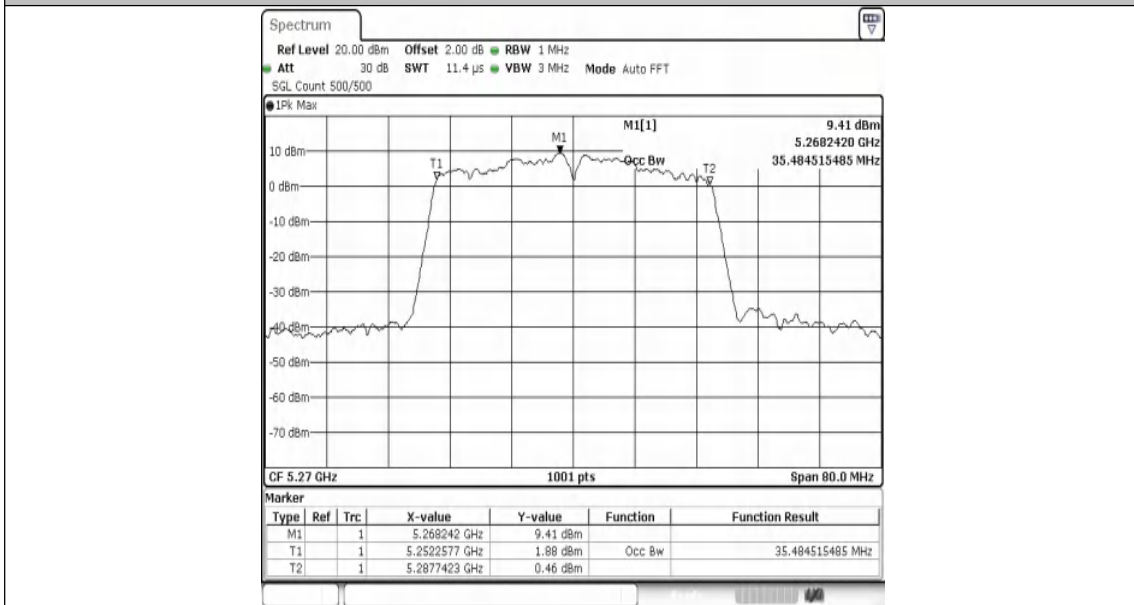


11AC40SISO-Ant1-5270

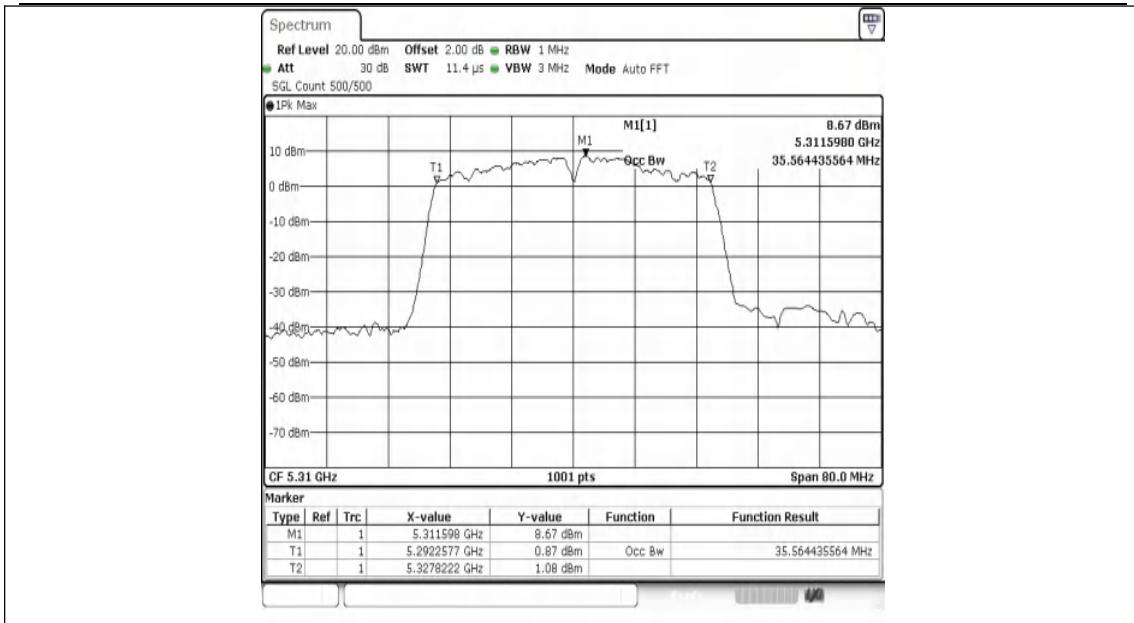


11AC40SISO-Ant1-5310

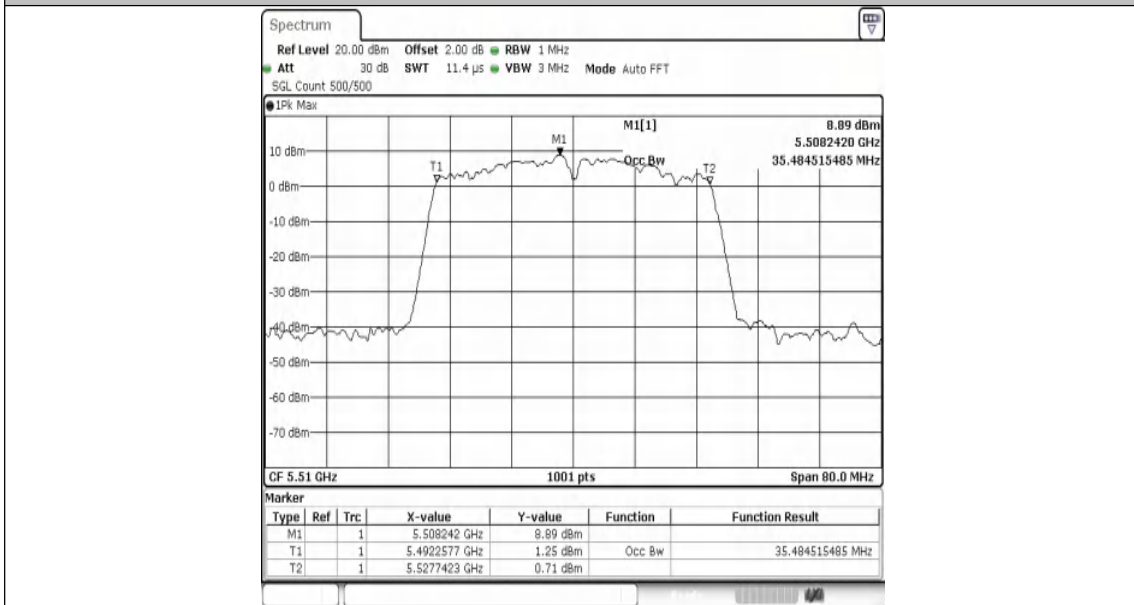


11AC40SISO-Ant1-5510

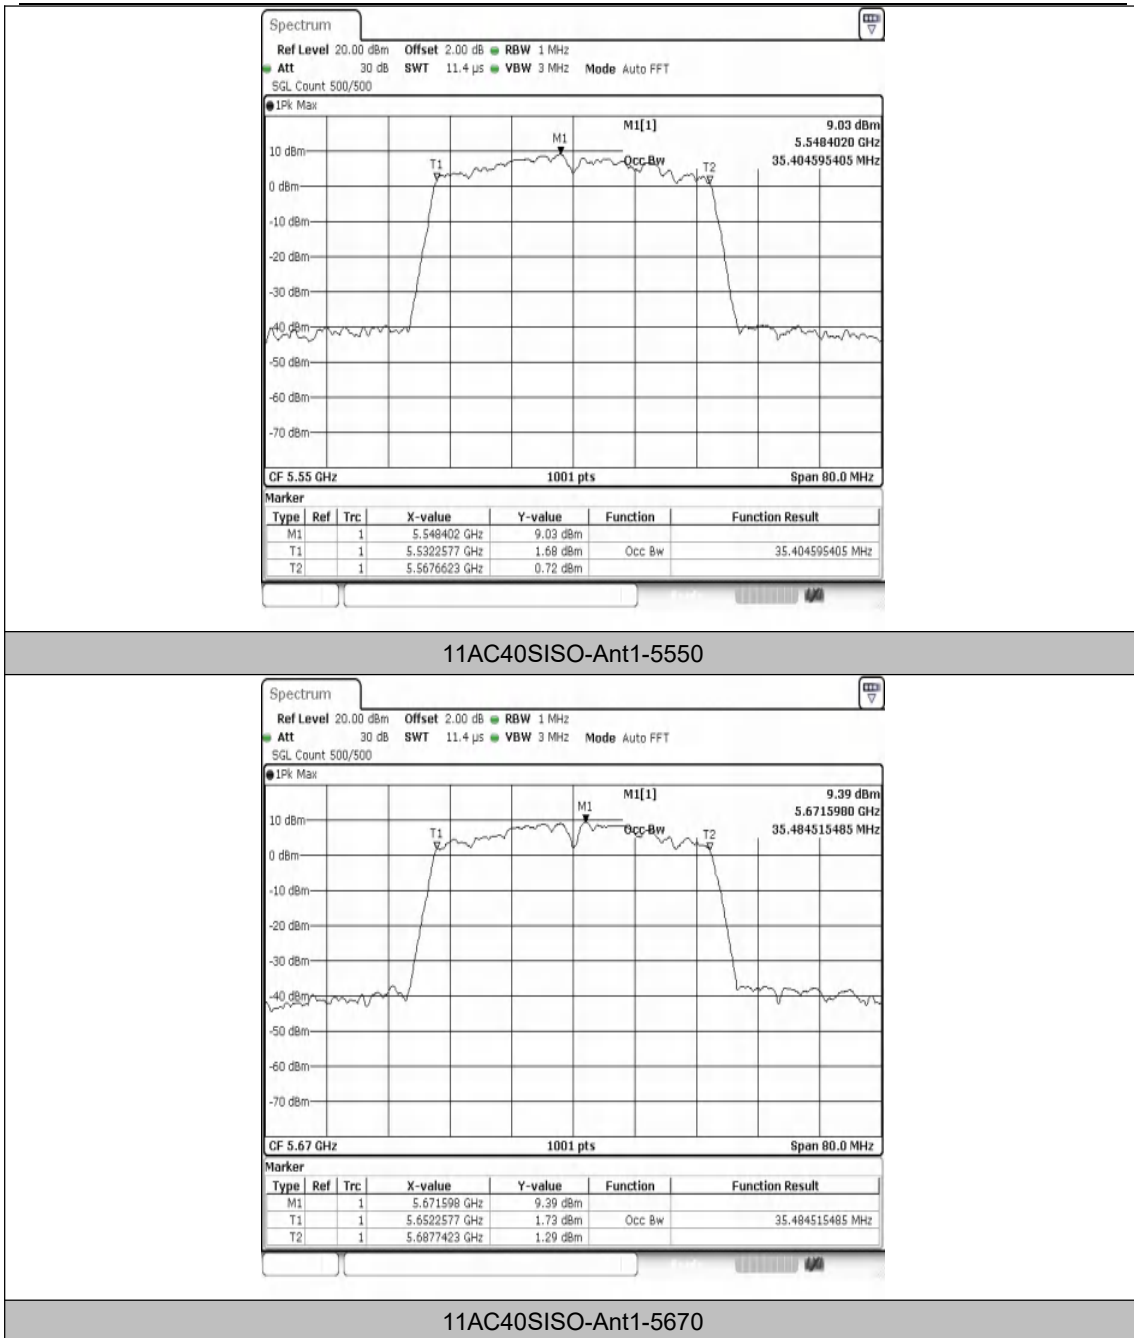


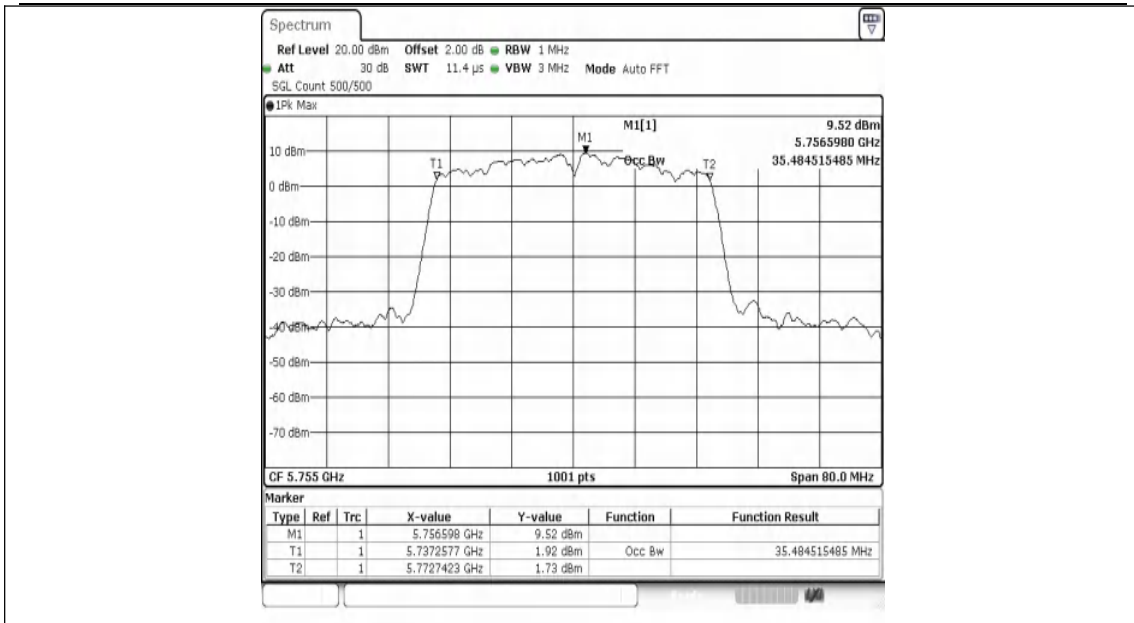


11AC40SISO-Ant1-5755

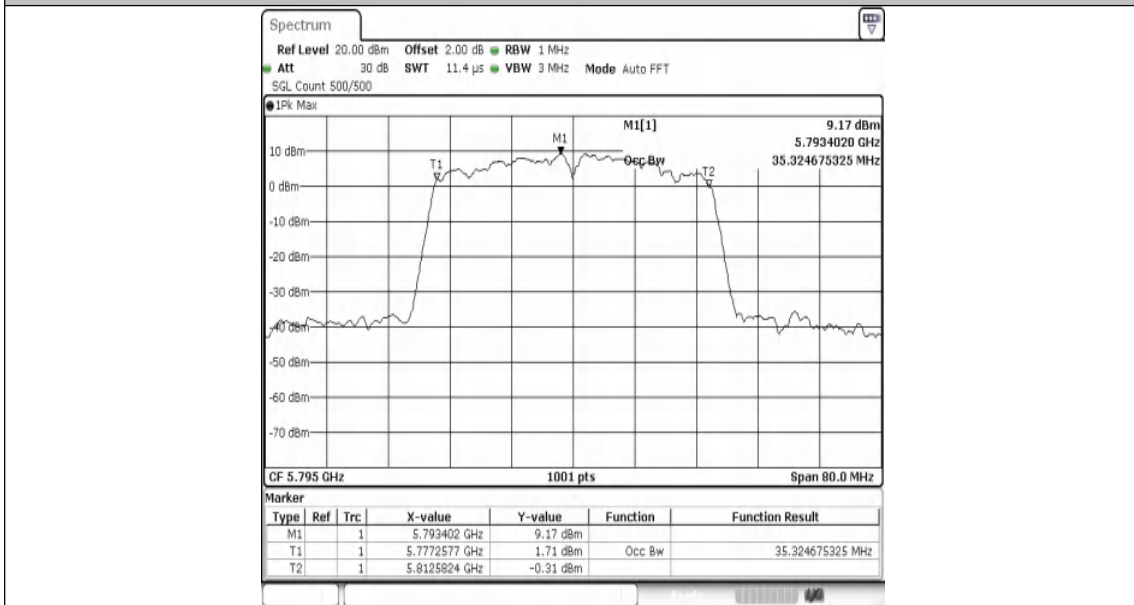


11AC40SISO-Ant1-5795

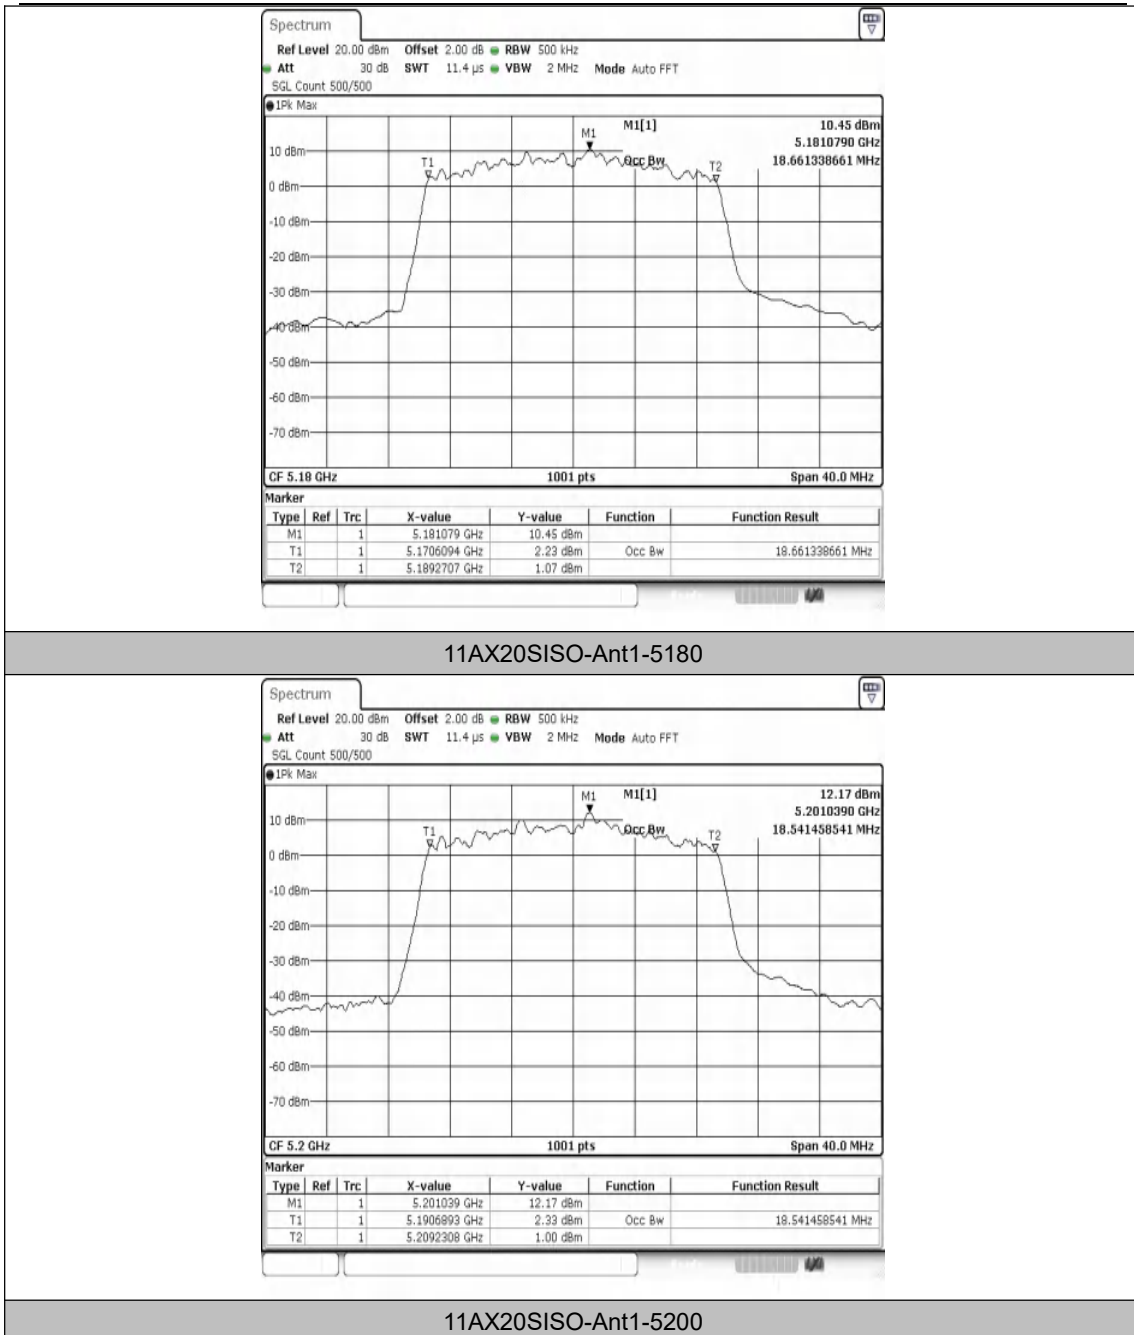


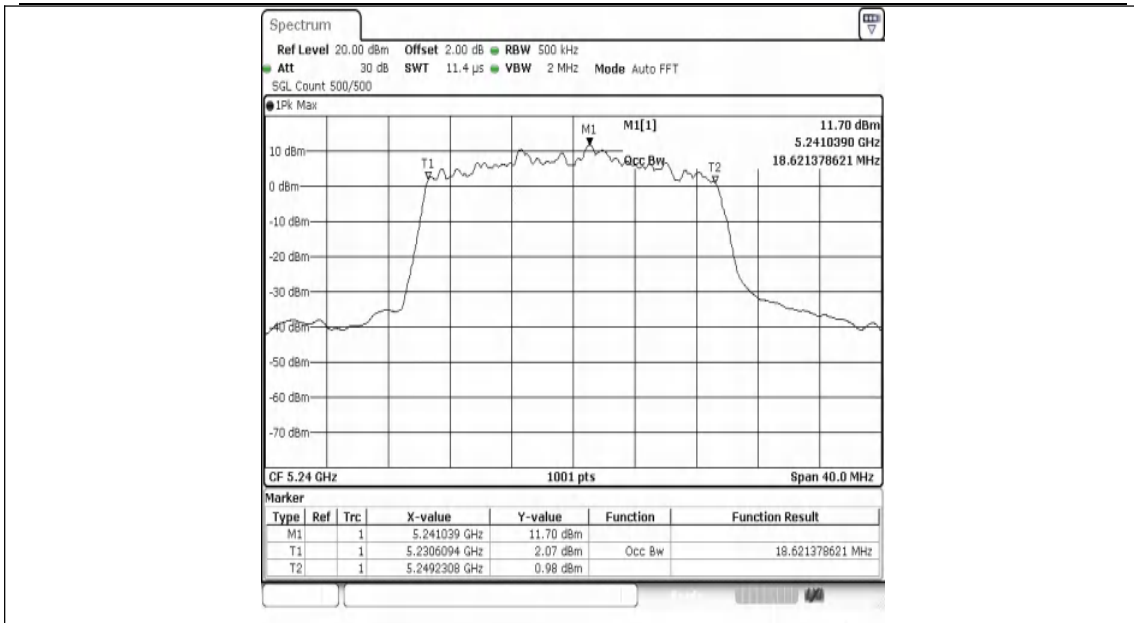


11AX20SISO-Ant1-5240

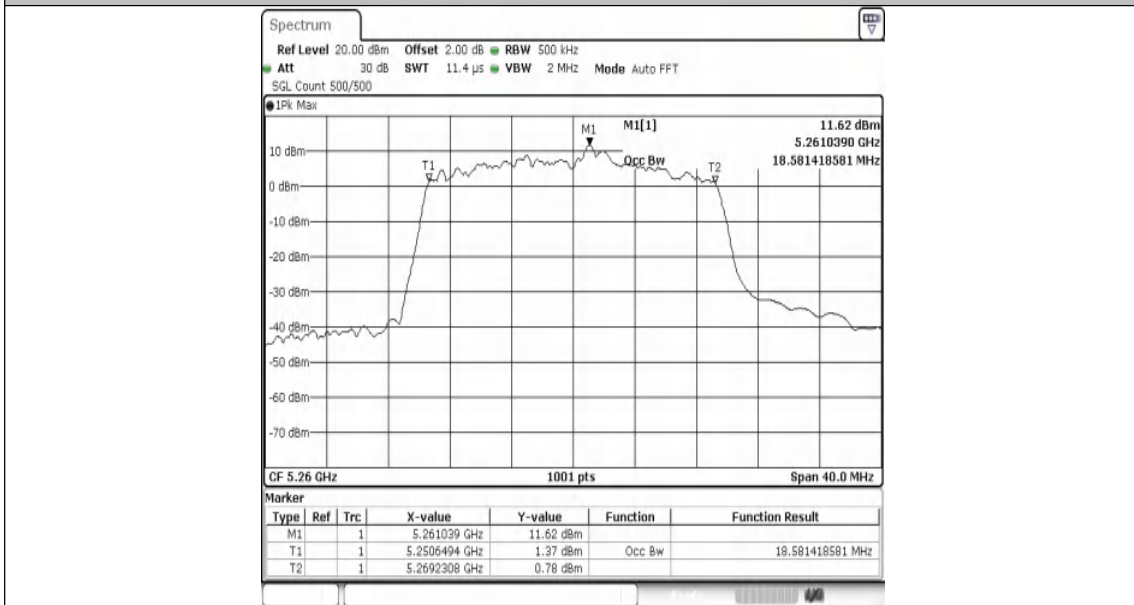

11AX20SISO-Ant1-5260

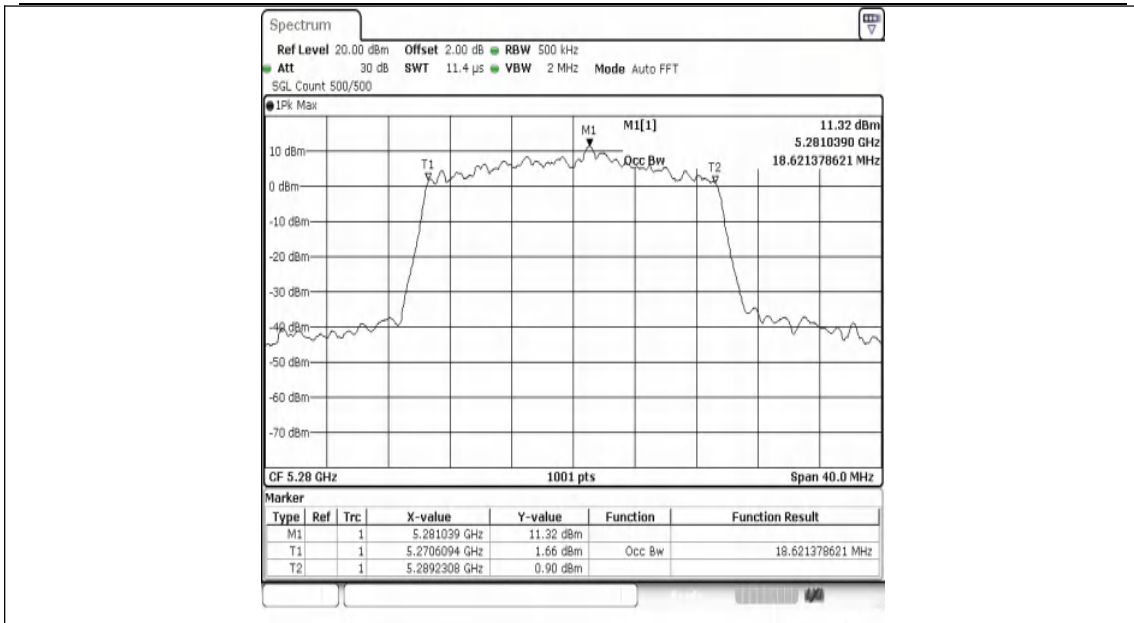

11AX20SISO-Ant1-5280

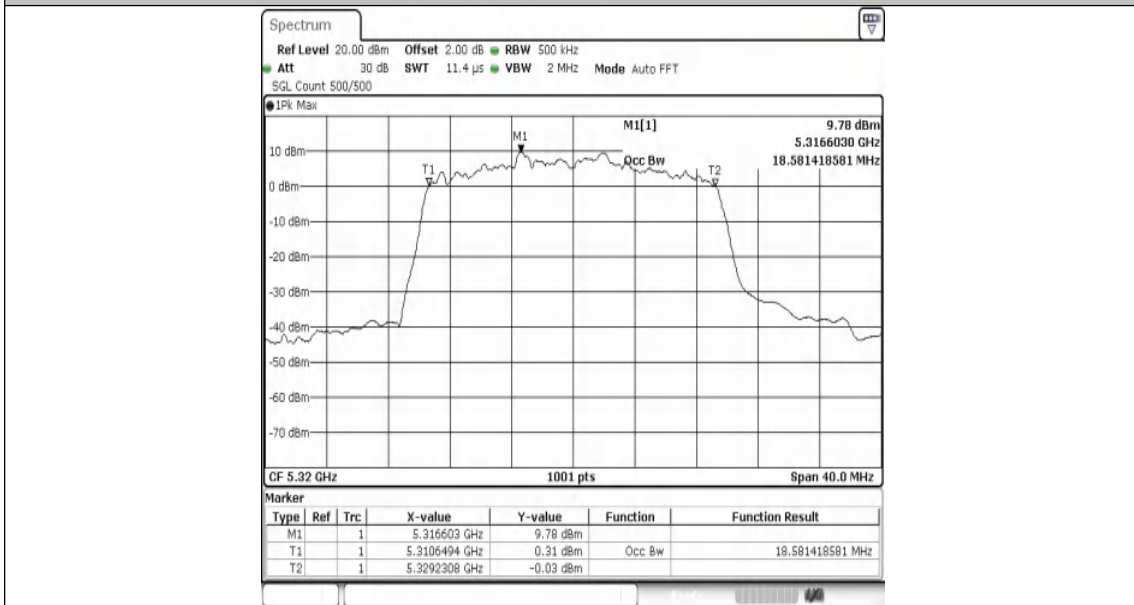


11AX20SISO-Ant1-5320

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

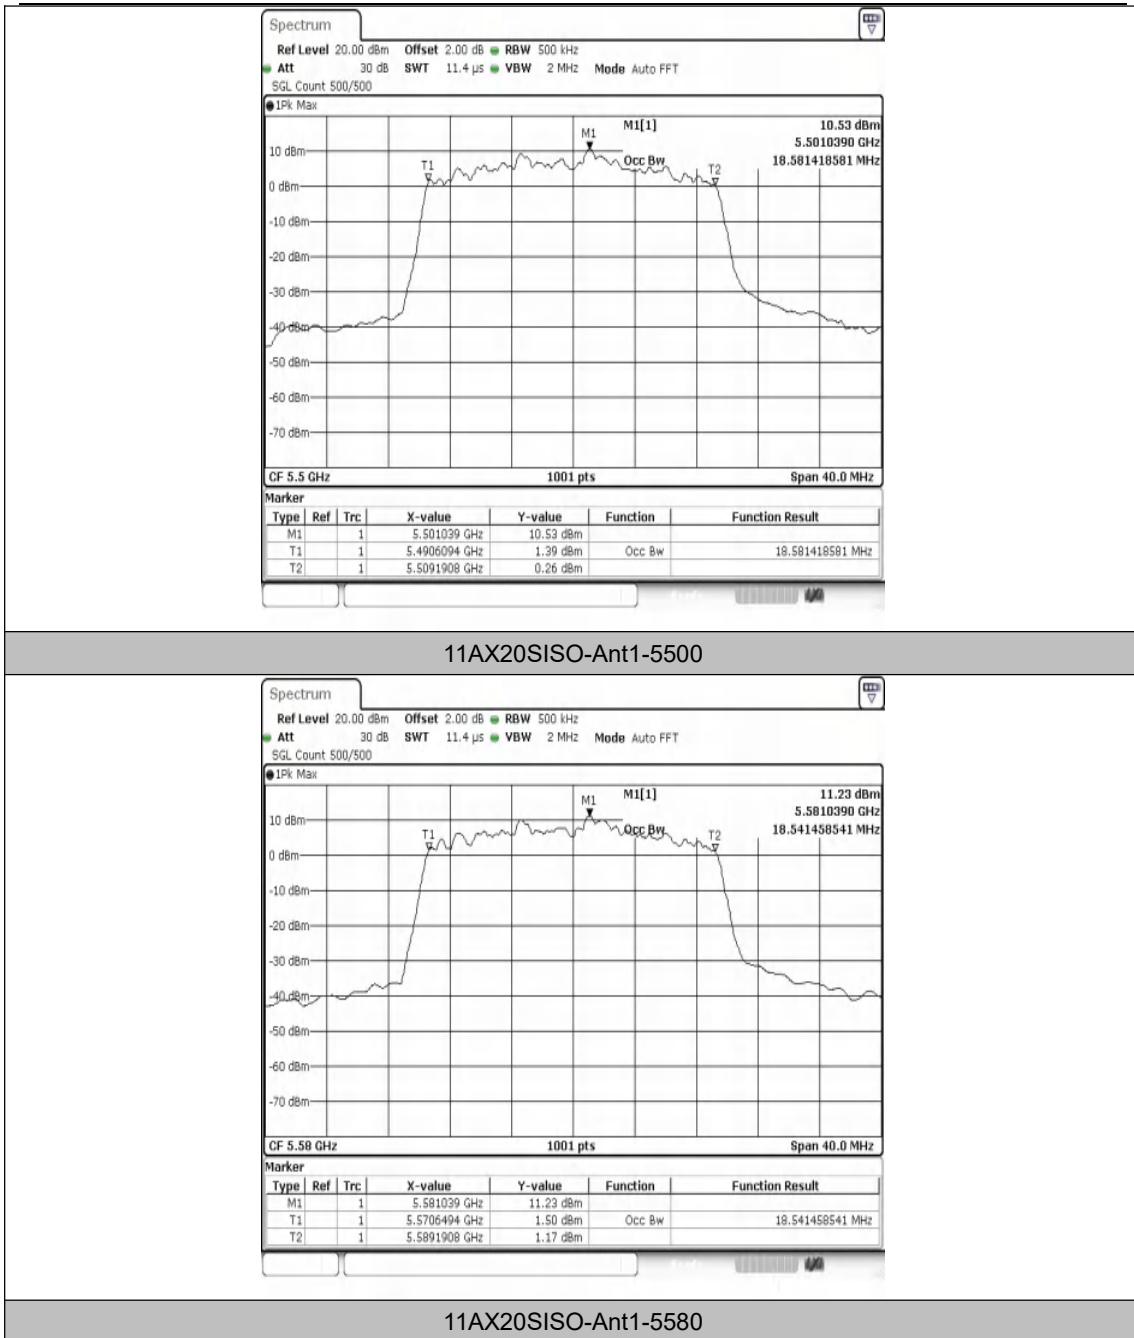


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

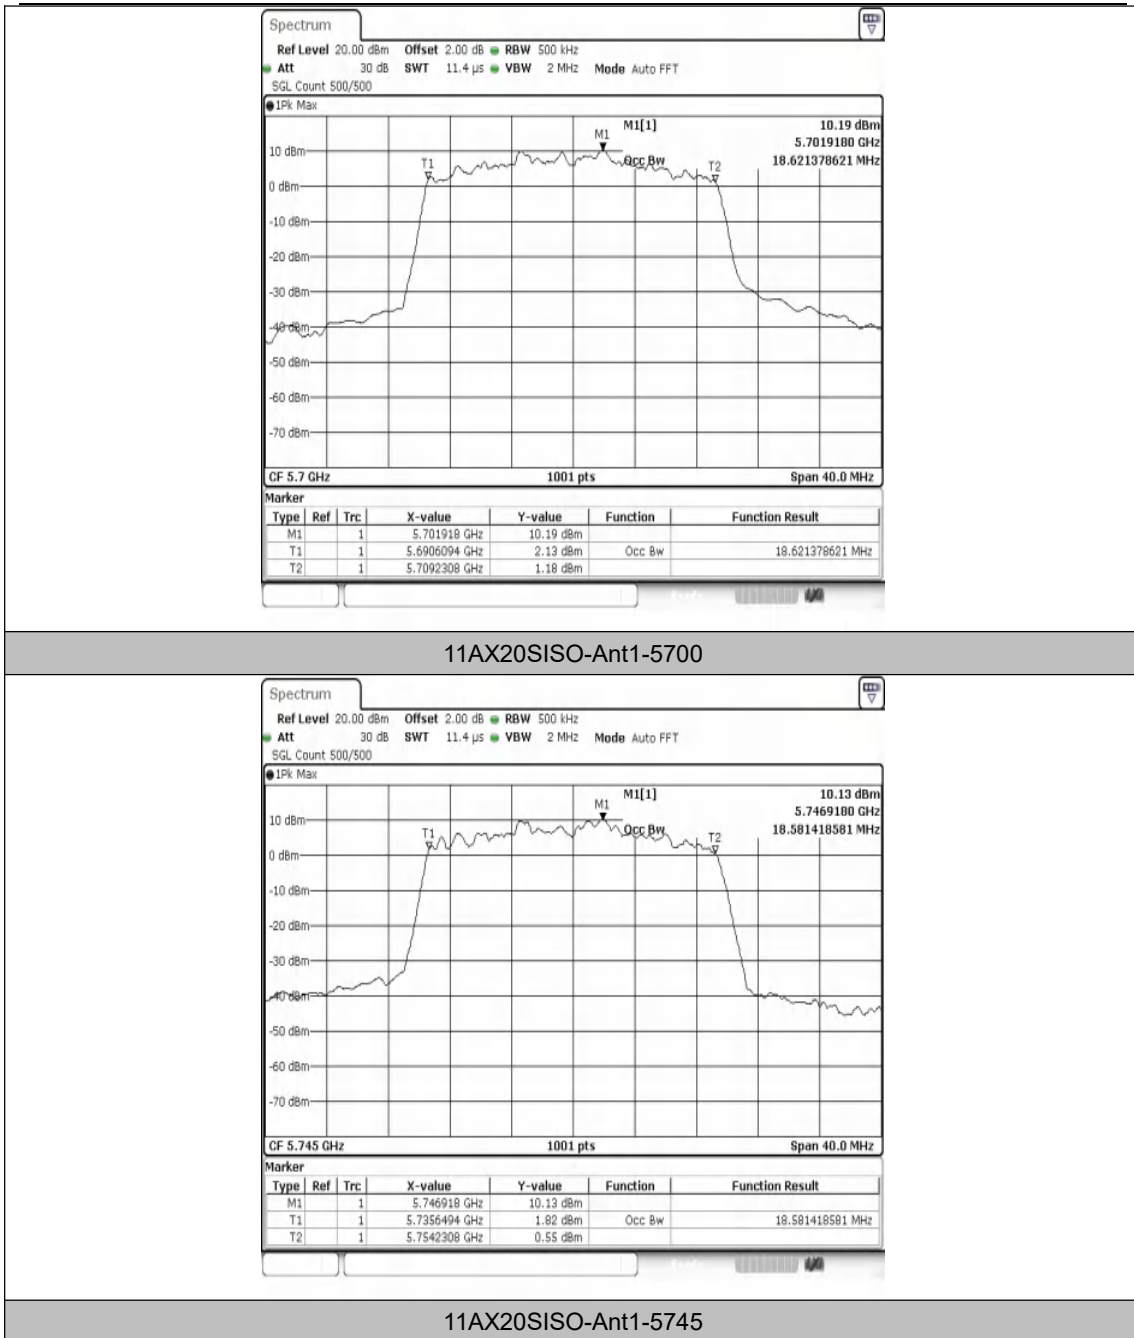


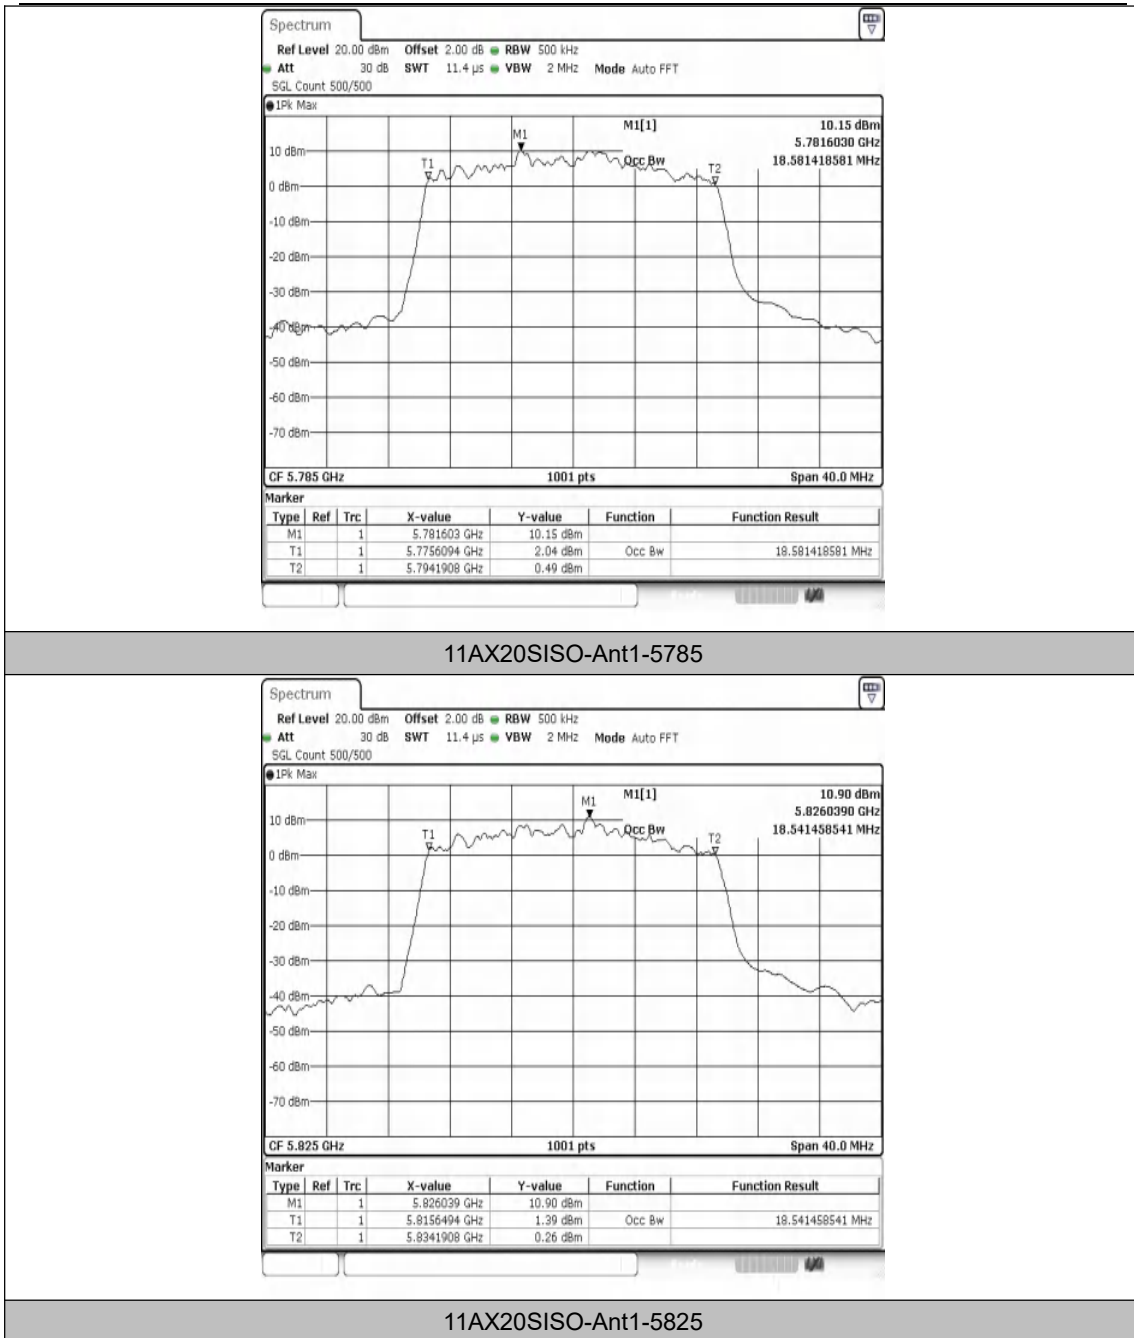


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

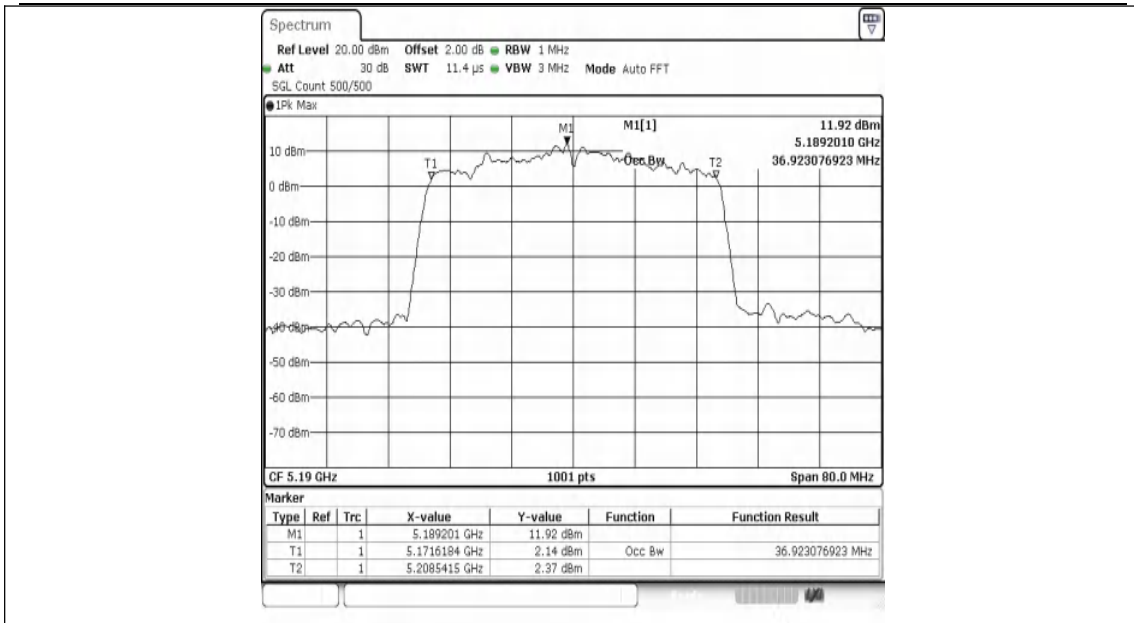



11AX40SISO-Ant1-5190

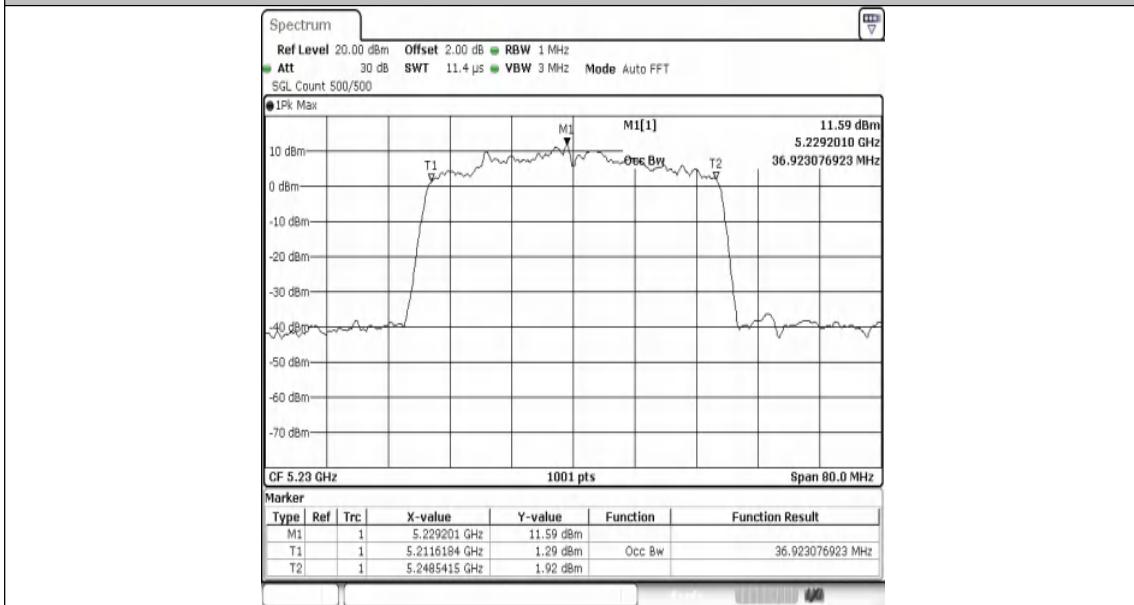


11AX40SISO-Ant1-5230

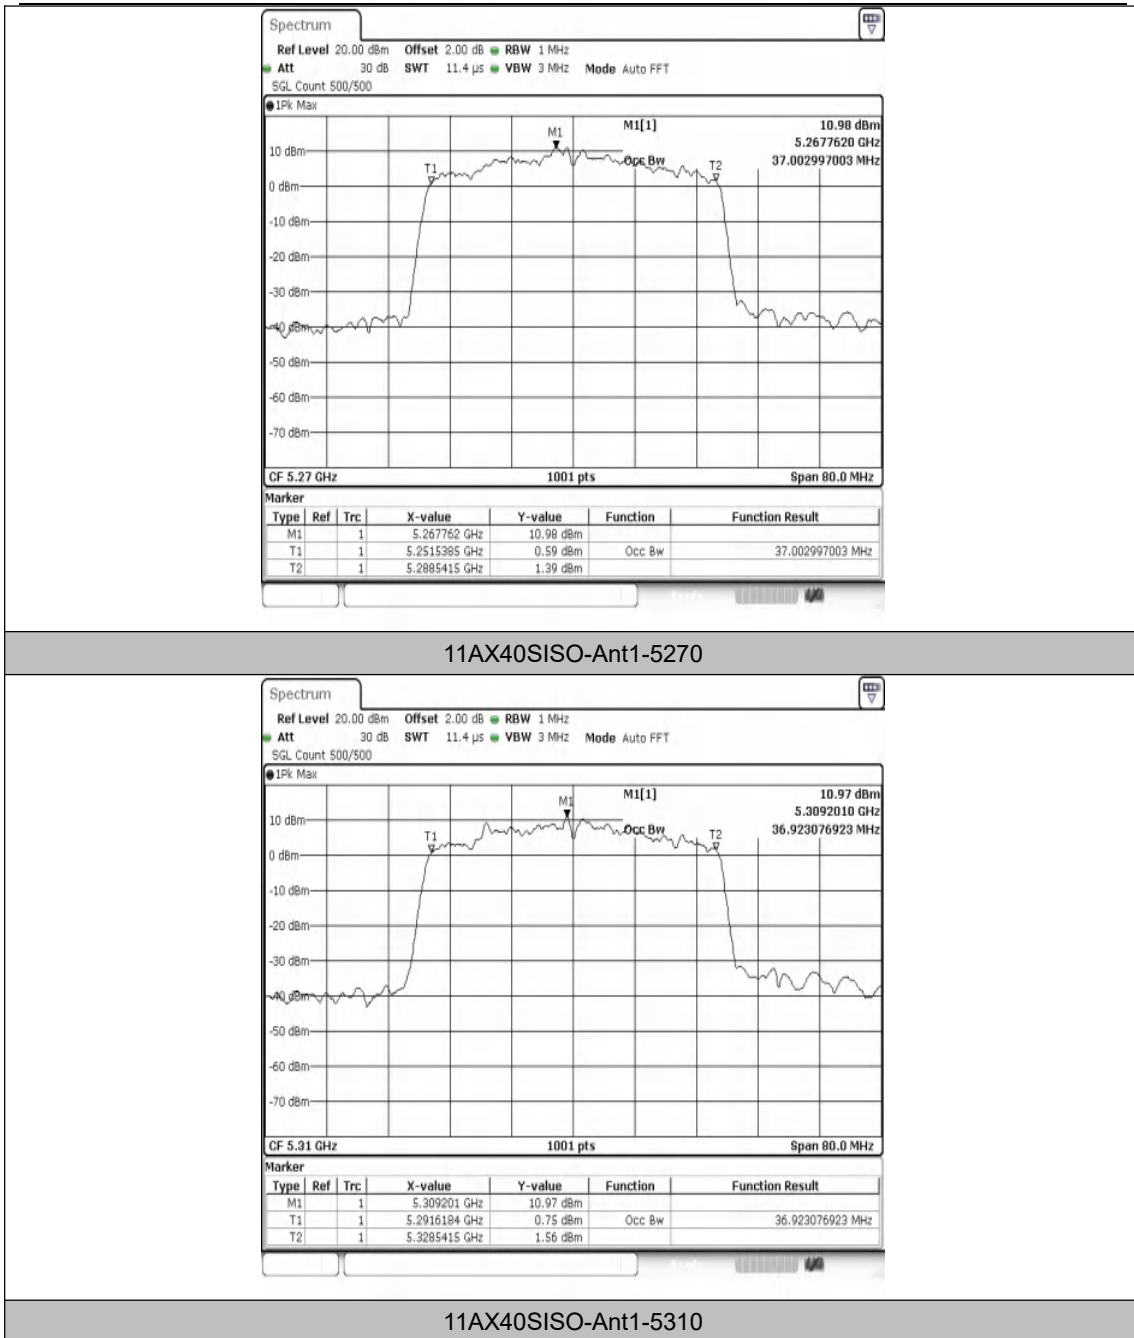

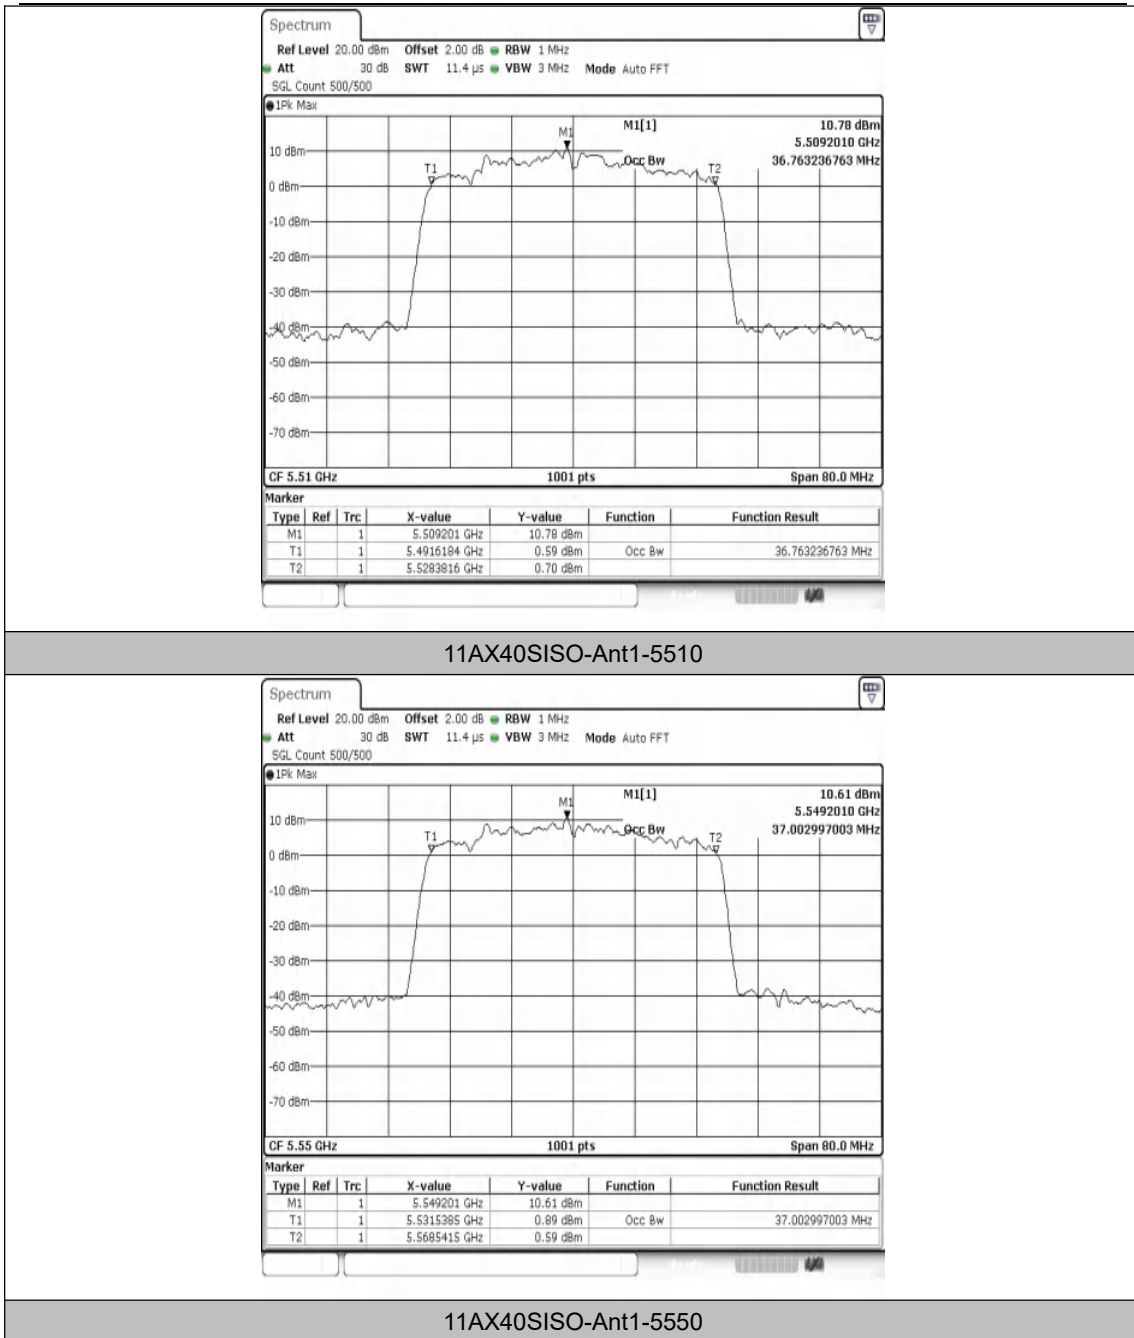


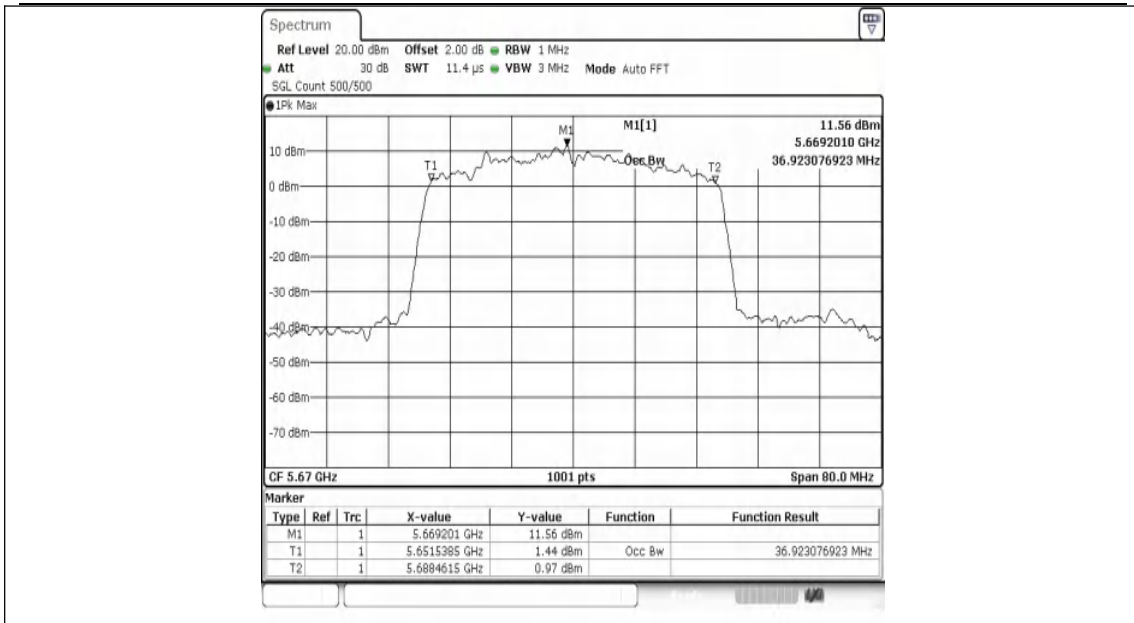

11AX40SISO-Ant1-5670

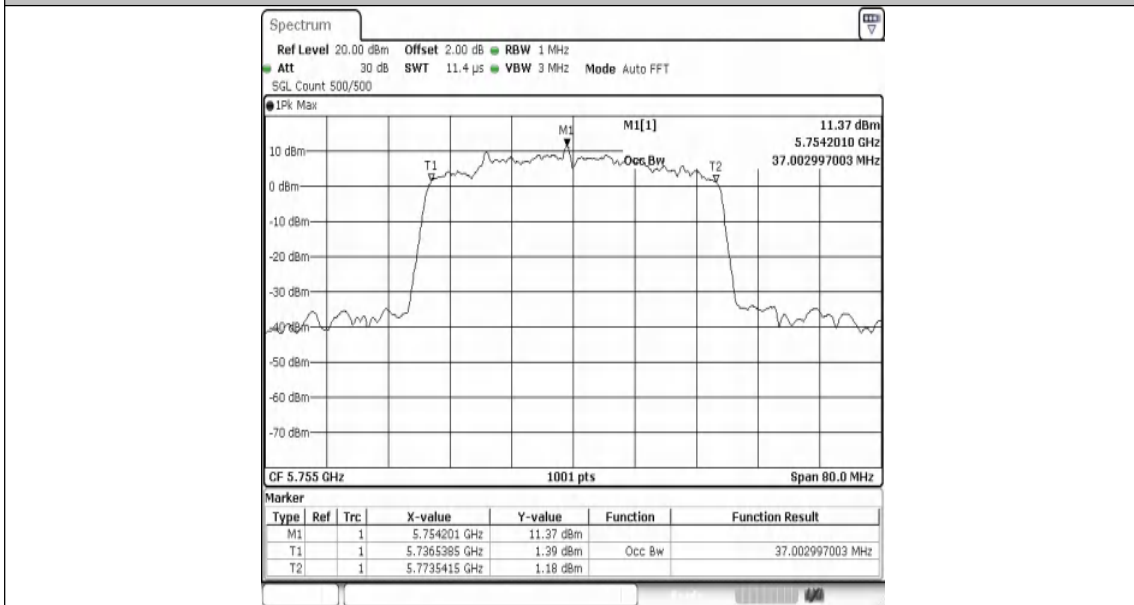

11AX40SISO-Ant1-5755

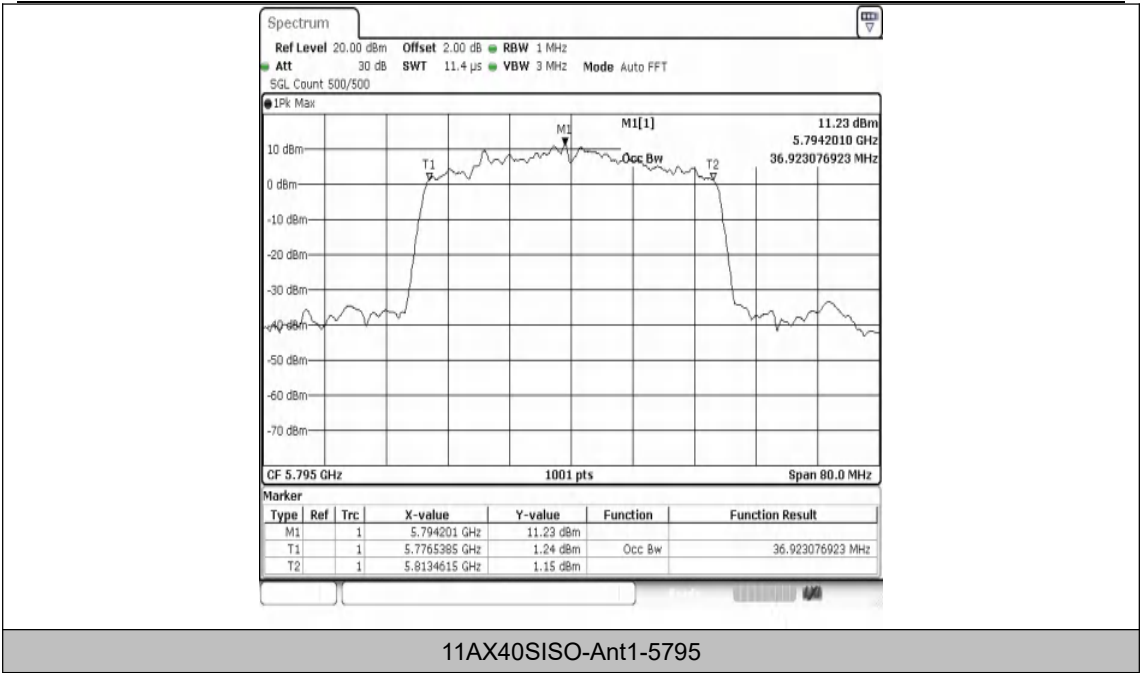

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix A3: Minimum 6dB Bandwidth

Test Result B4


Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	13.84	5738.68	5752.52	0.5	PASS
11A	Ant1	5785	13.84	5778.68	5792.52	0.5	PASS
11A	Ant1	5825	13.84	5818.68	5832.52	0.5	PASS
11N20SISO	Ant1	5745	15.08	5737.44	5752.52	0.5	PASS
11N20SISO	Ant1	5785	15.08	5777.44	5792.52	0.5	PASS
11N20SISO	Ant1	5825	15.08	5817.44	5832.52	0.5	PASS
11N40SISO	Ant1	5755	33.84	5738.68	5772.52	0.5	PASS
11N40SISO	Ant1	5795	32.56	5778.68	5811.24	0.5	PASS
11AC20SISO	Ant1	5745	16.16	5736.60	5752.76	0.5	PASS
11AC20SISO	Ant1	5785	12.60	5778.68	5791.28	0.5	PASS
11AC20SISO	Ant1	5825	15.08	5817.44	5832.52	0.5	PASS
11AC40SISO	Ant1	5755	33.84	5738.68	5772.52	0.5	PASS
11AC40SISO	Ant1	5795	33.84	5778.68	5812.52	0.5	PASS
11AX20SISO	Ant1	5745	12.60	5738.68	5751.28	0.5	PASS
11AX20SISO	Ant1	5785	15.08	5777.44	5792.52	0.5	PASS
11AX20SISO	Ant1	5825	15.04	5817.48	5832.52	0.5	PASS
11AX40SISO	Ant1	5755	31.36	5738.68	5770.04	0.5	PASS
11AX40SISO	Ant1	5795	31.36	5778.68	5810.04	0.5	PASS

Test Graphs B4

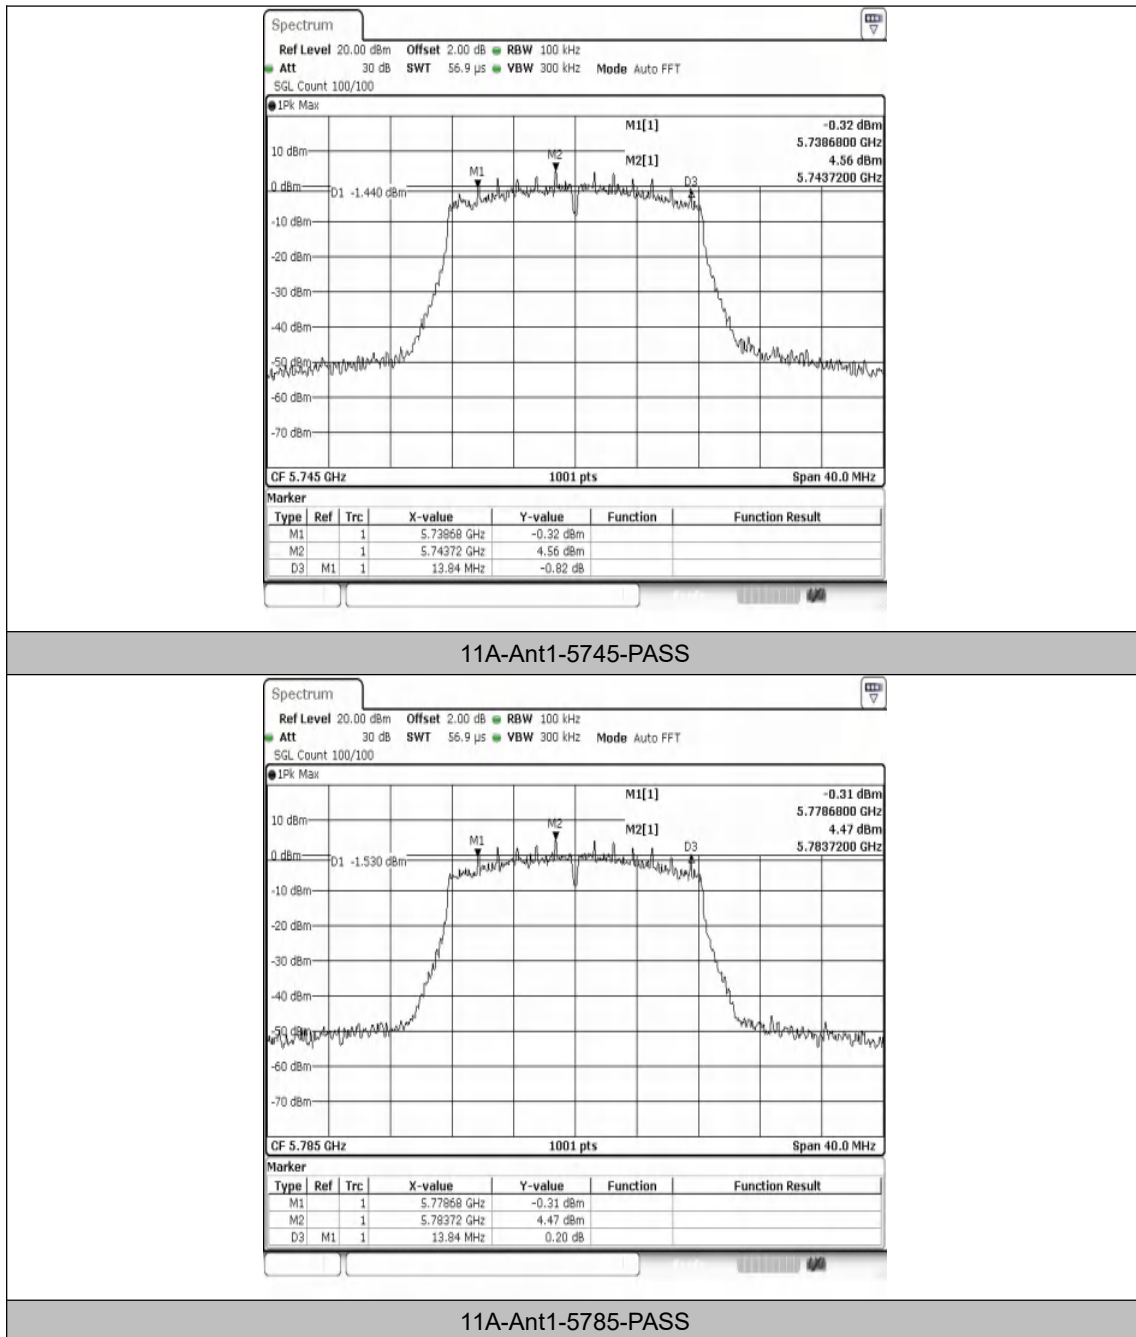


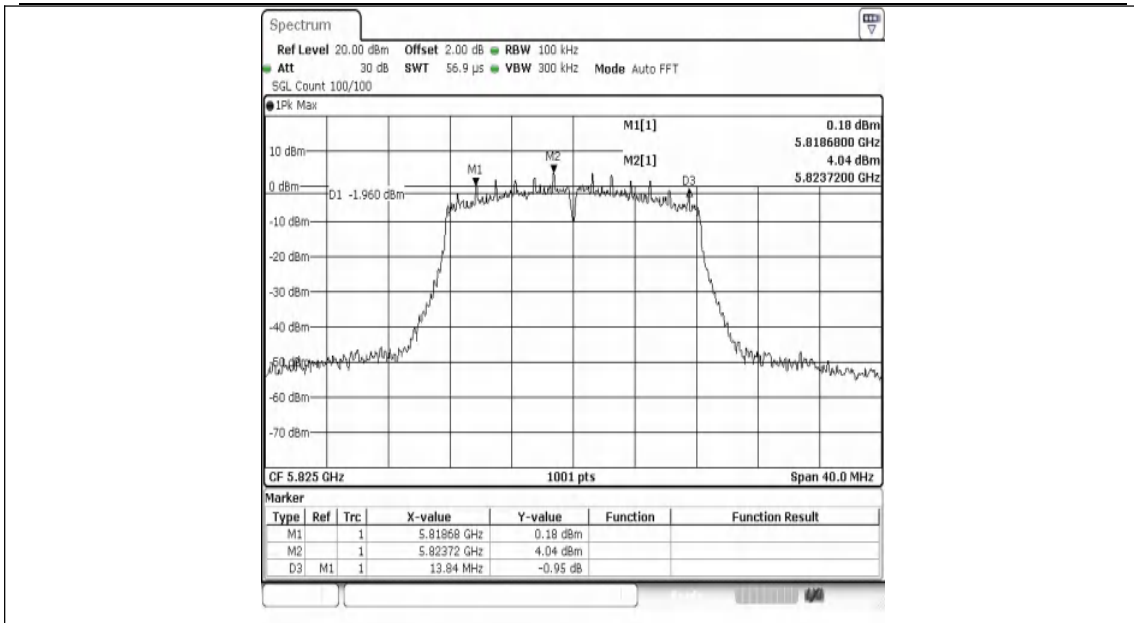


11A-Ant1-5825-PASS

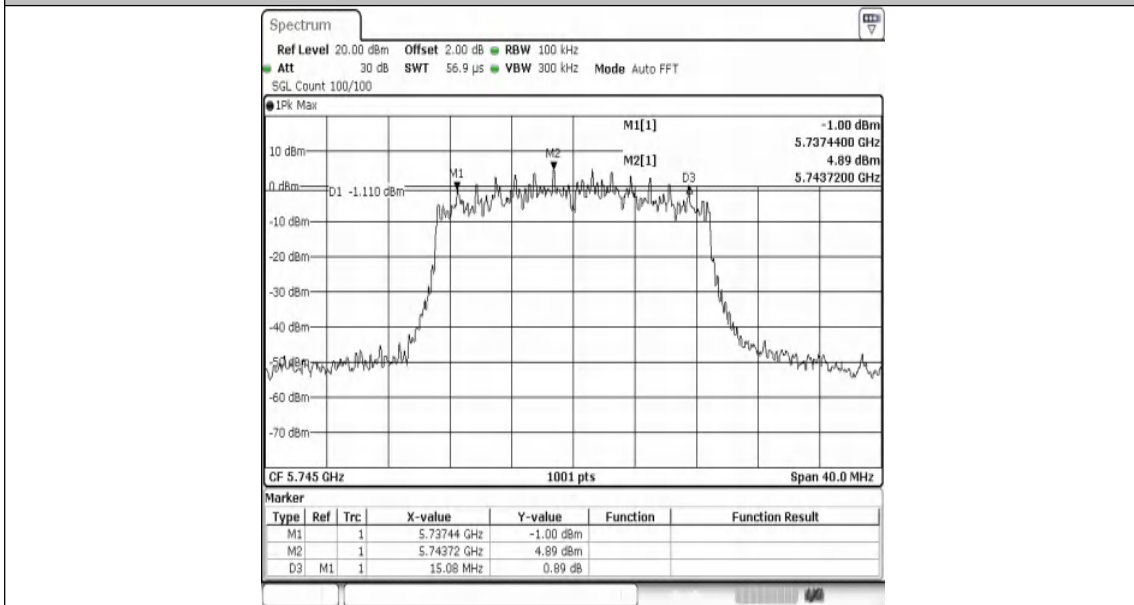


11N20SISO-Ant1-5745-PASS

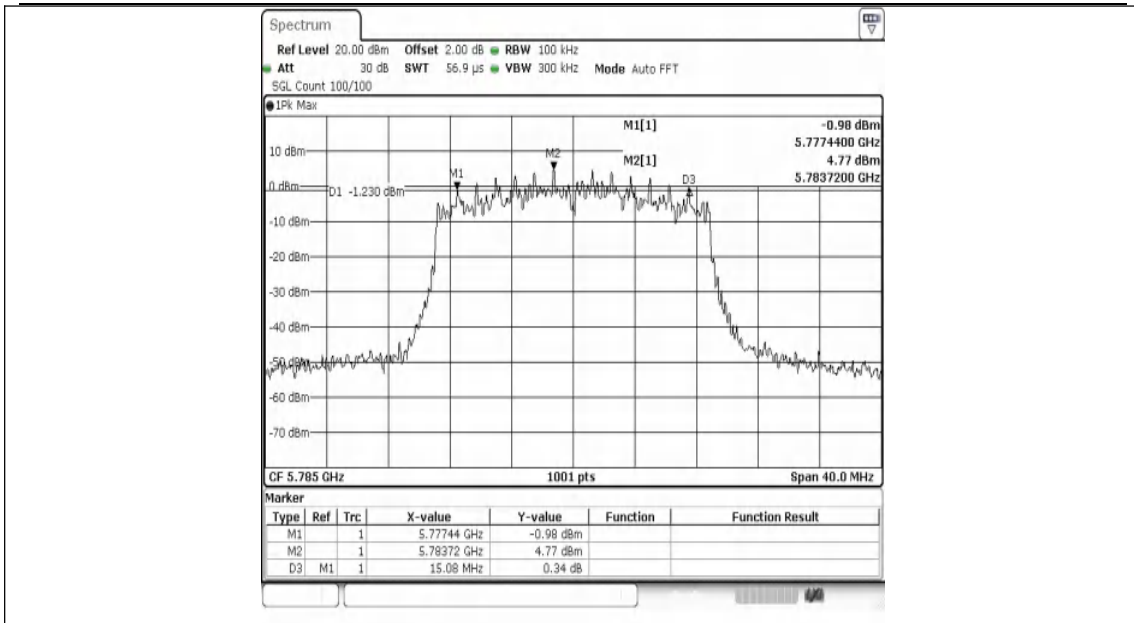


11N20SISO-Ant1-5785-PASS

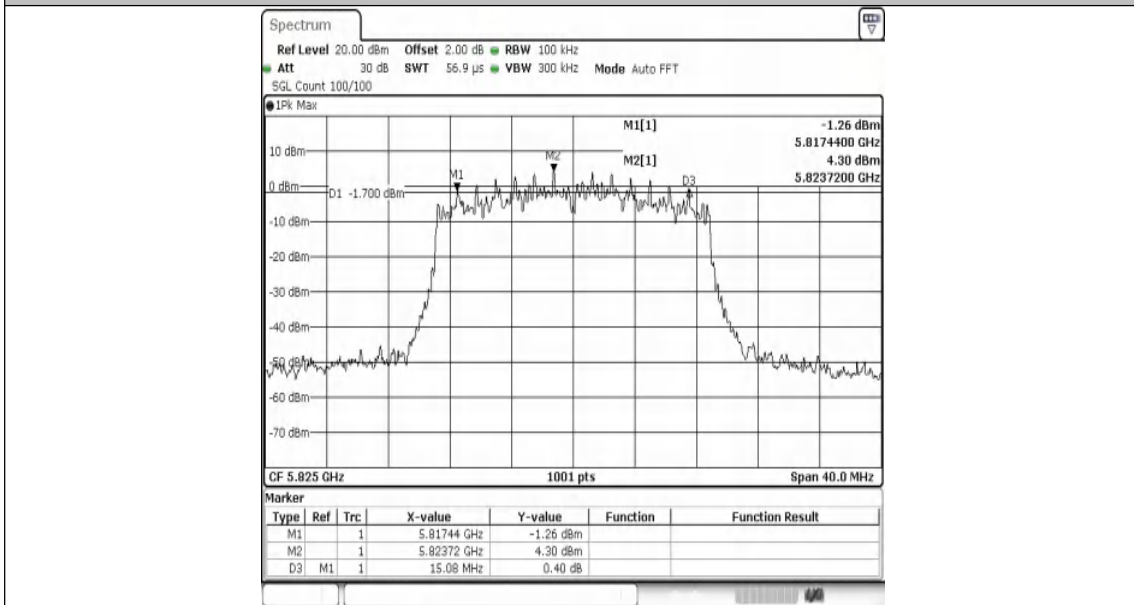


11N20SISO-Ant1-5825-PASS

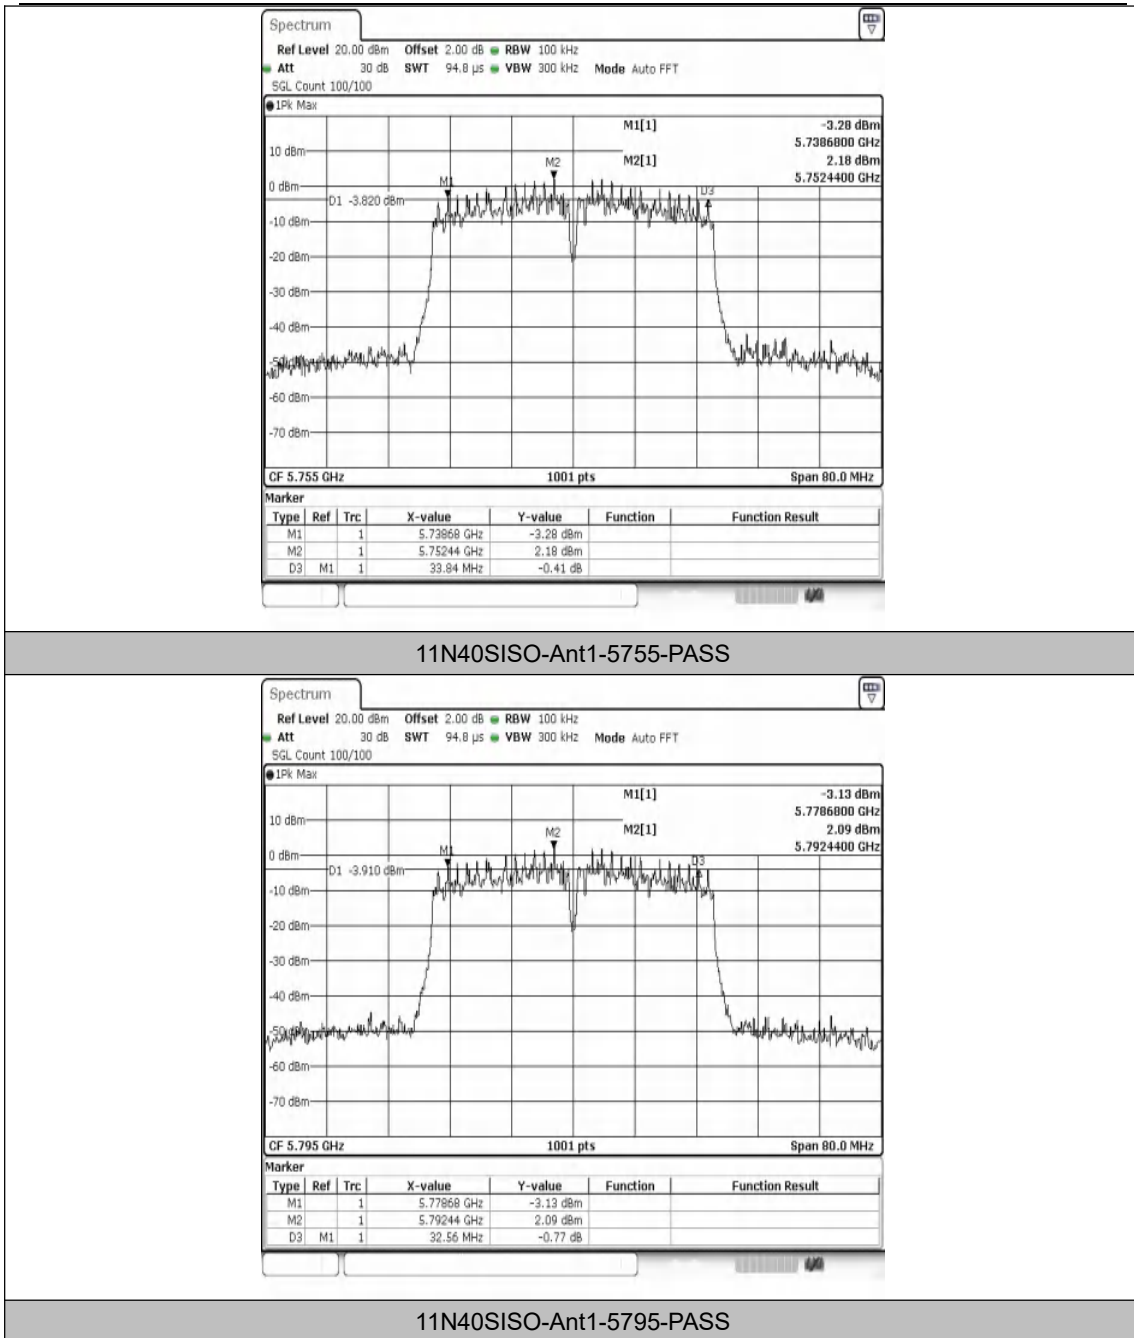


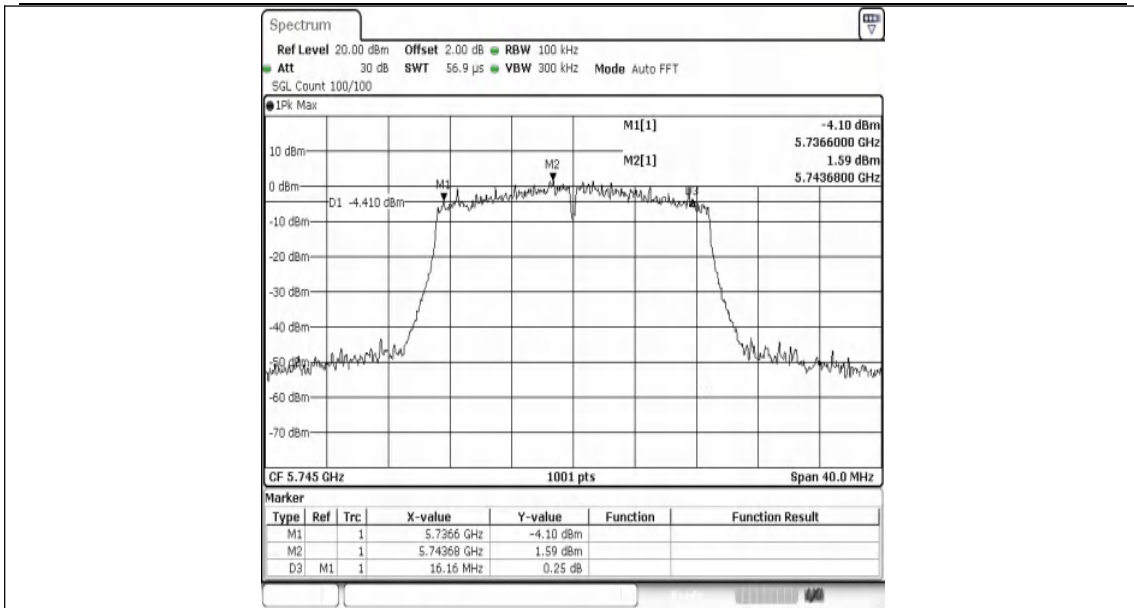


11AC20SISO-Ant1-5745-PASS

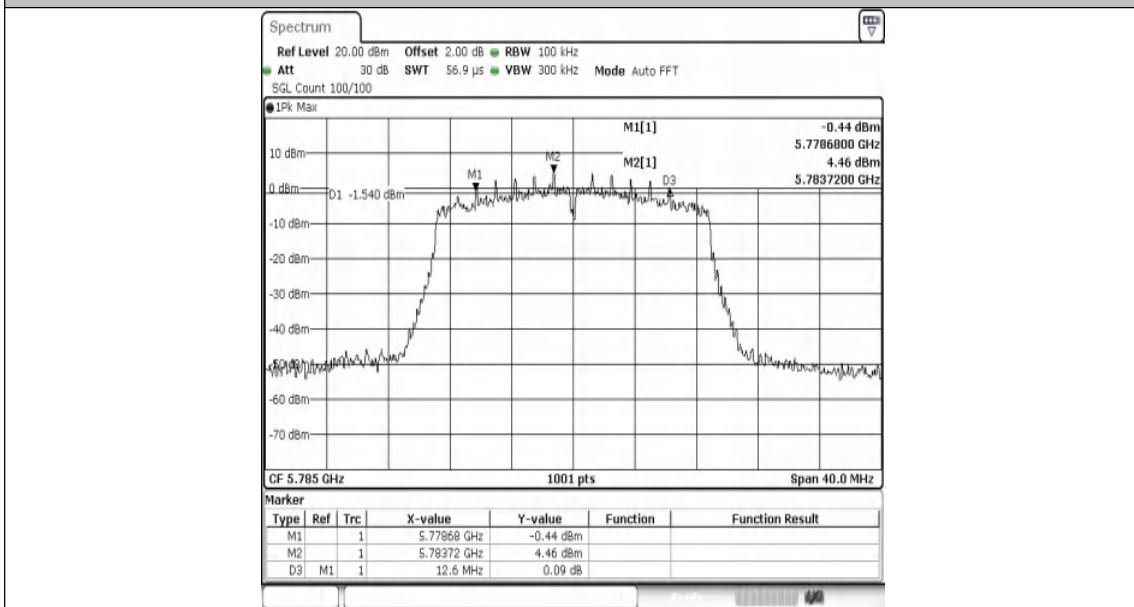


11AC20SISO-Ant1-5785-PASS

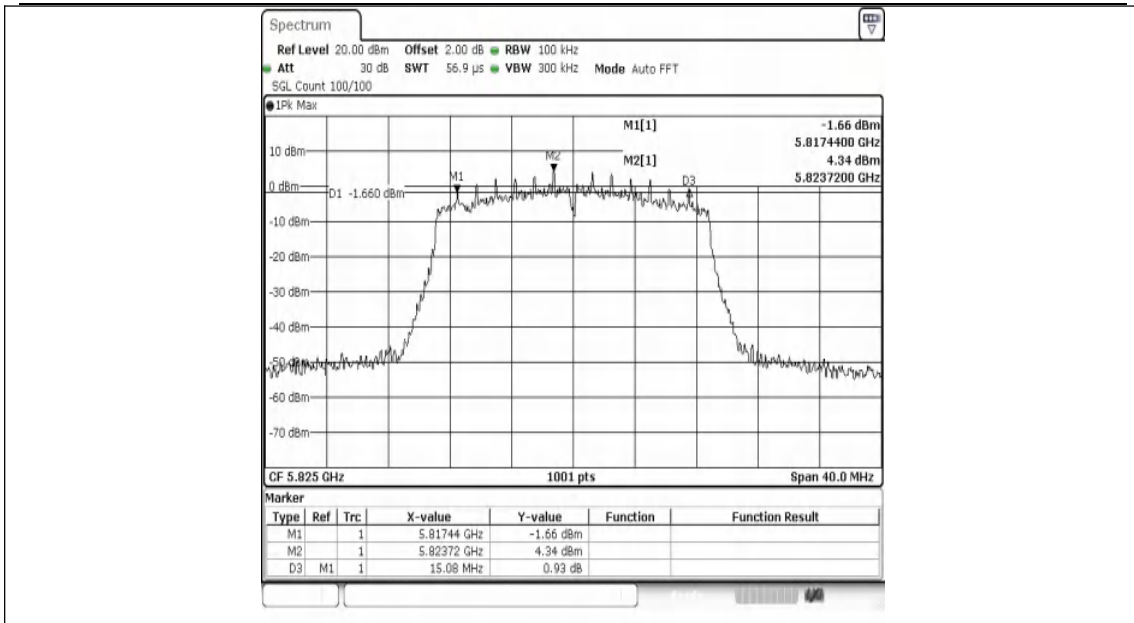


11AC20SISO-Ant1-5825-PASS

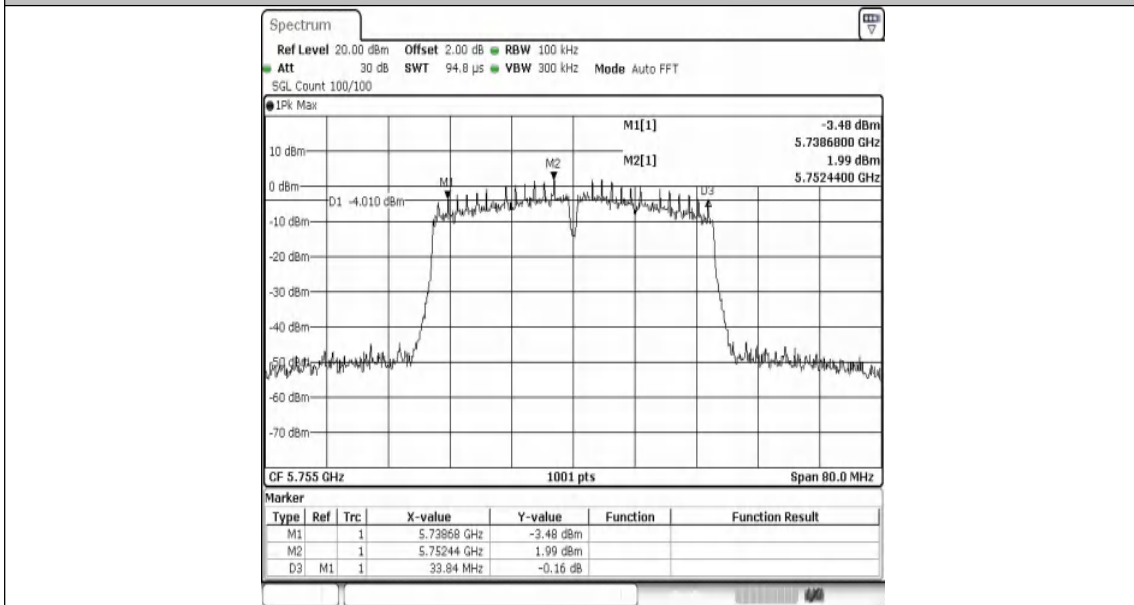


11AC40SISO-Ant1-5755-PASS

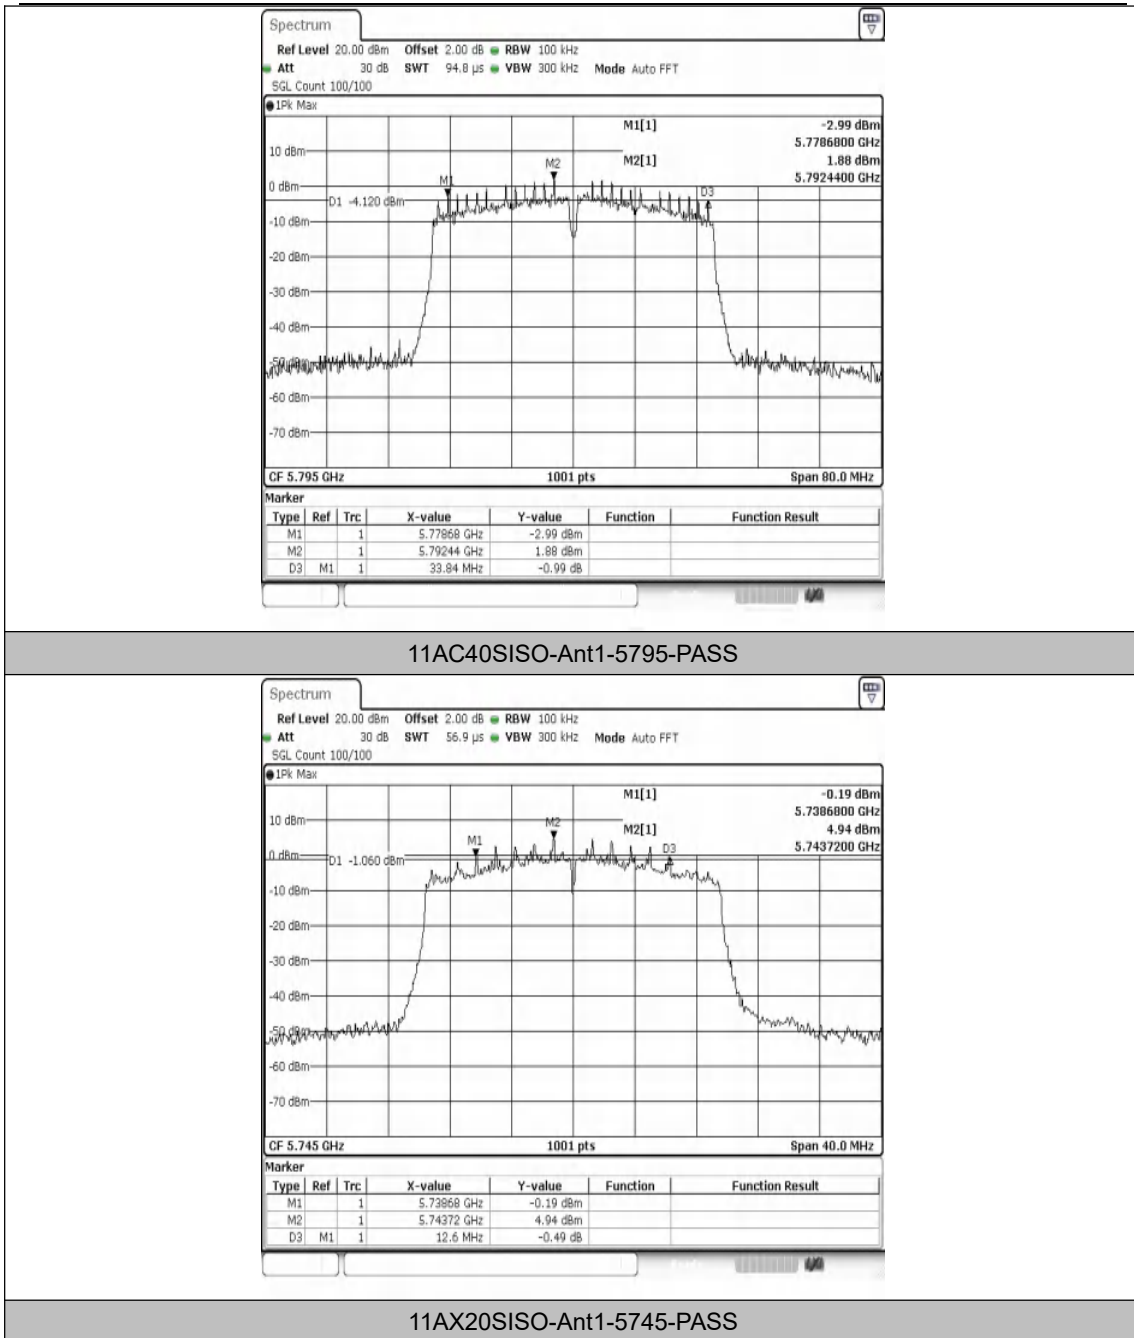


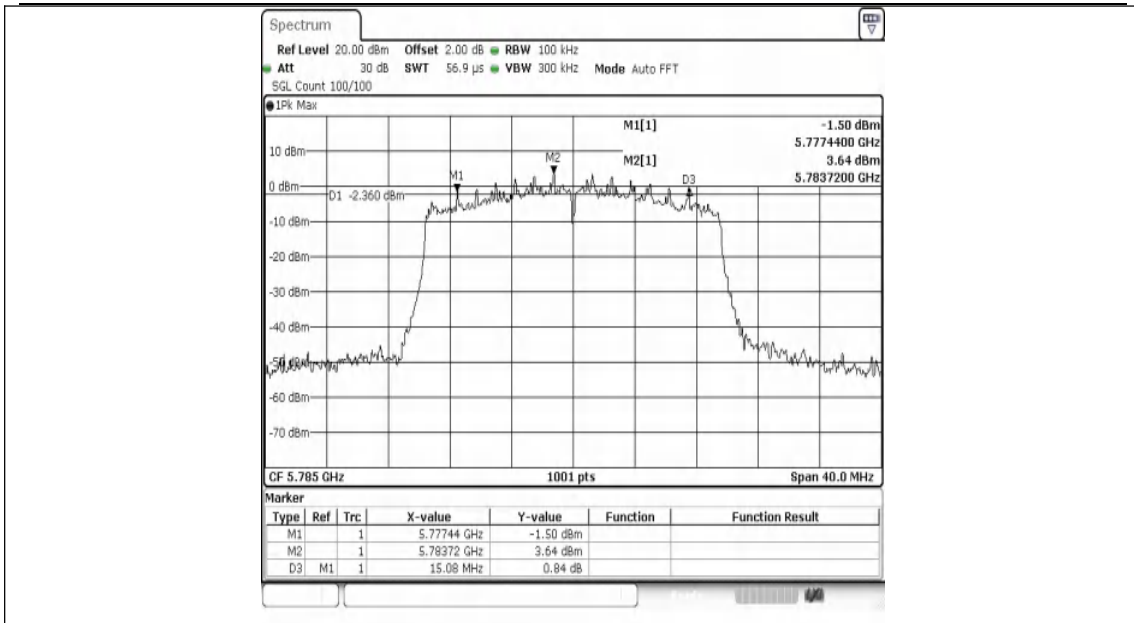

11AX20SISO-Ant1-5785-PASS

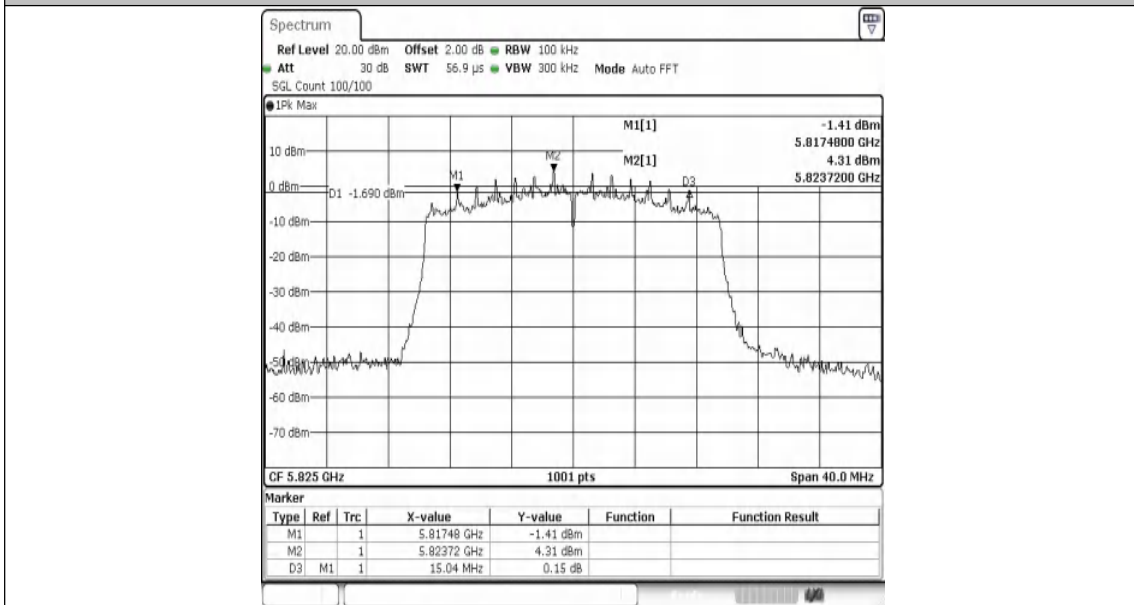

11AX20SISO-Ant1-5825-PASS

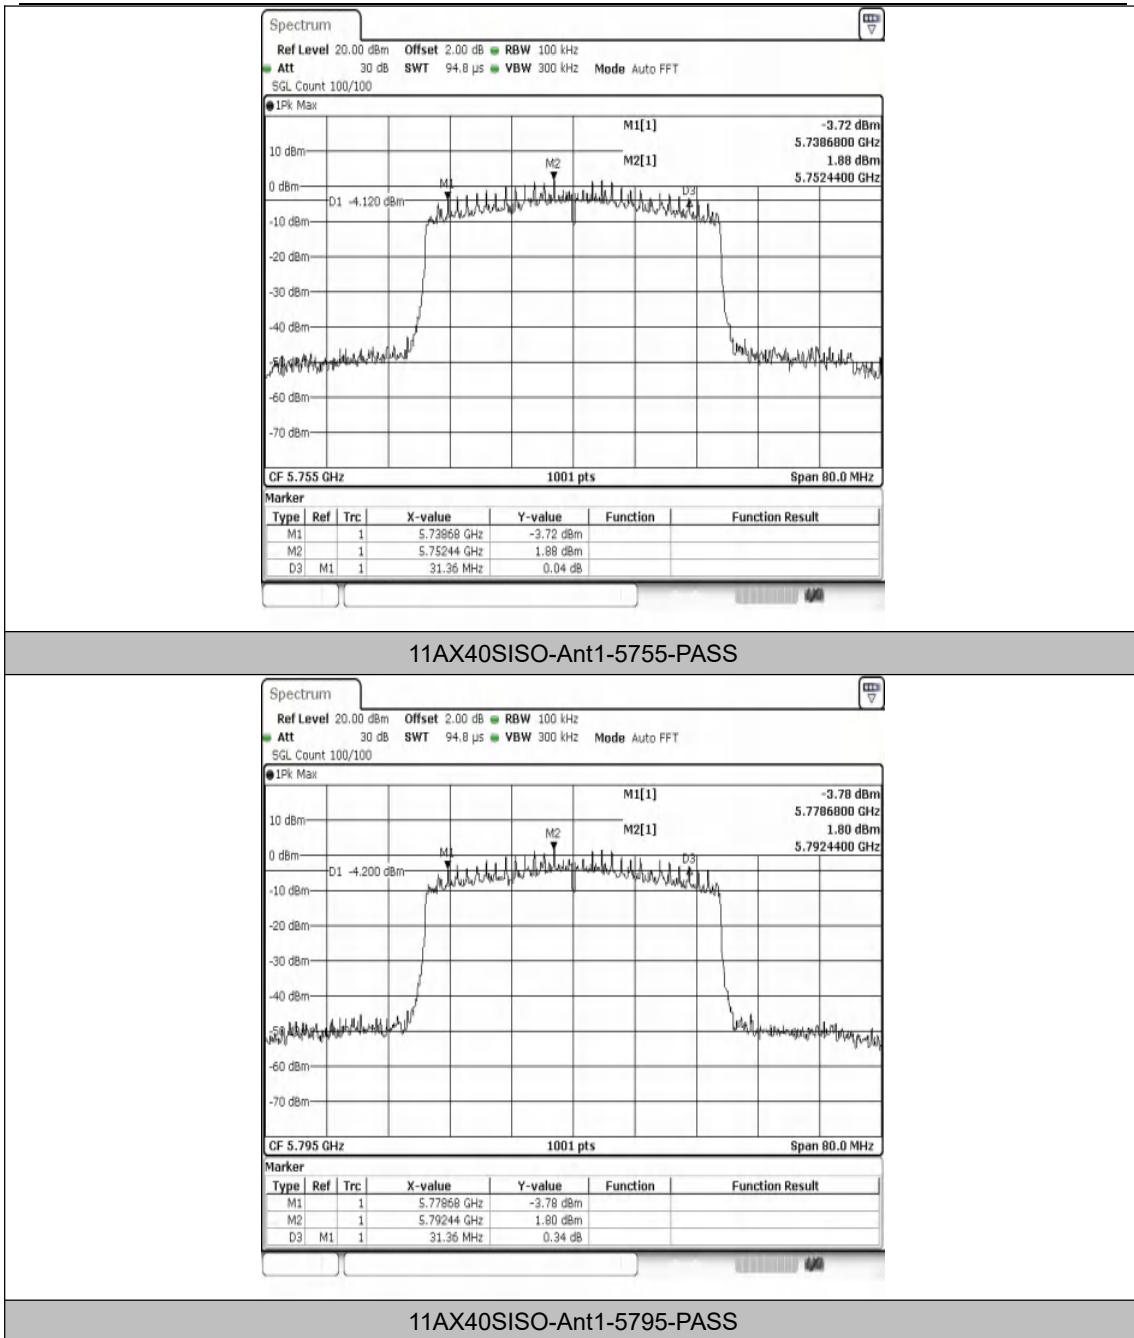


Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5260	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5280	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5320	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5500	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5580	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5700	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5260	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5280	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5320	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5500	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5580	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5700	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5270	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5310	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5510	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5550	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5670	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01

11AC20SISO	Ant1	5260	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5280	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5320	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5500	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5580	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5700	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5270	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5310	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5510	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5550	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5670	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5260	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5280	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5320	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5500	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5580	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5700	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AX20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5270	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5310	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5510	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5550	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5670	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AX40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01


Test Graphs

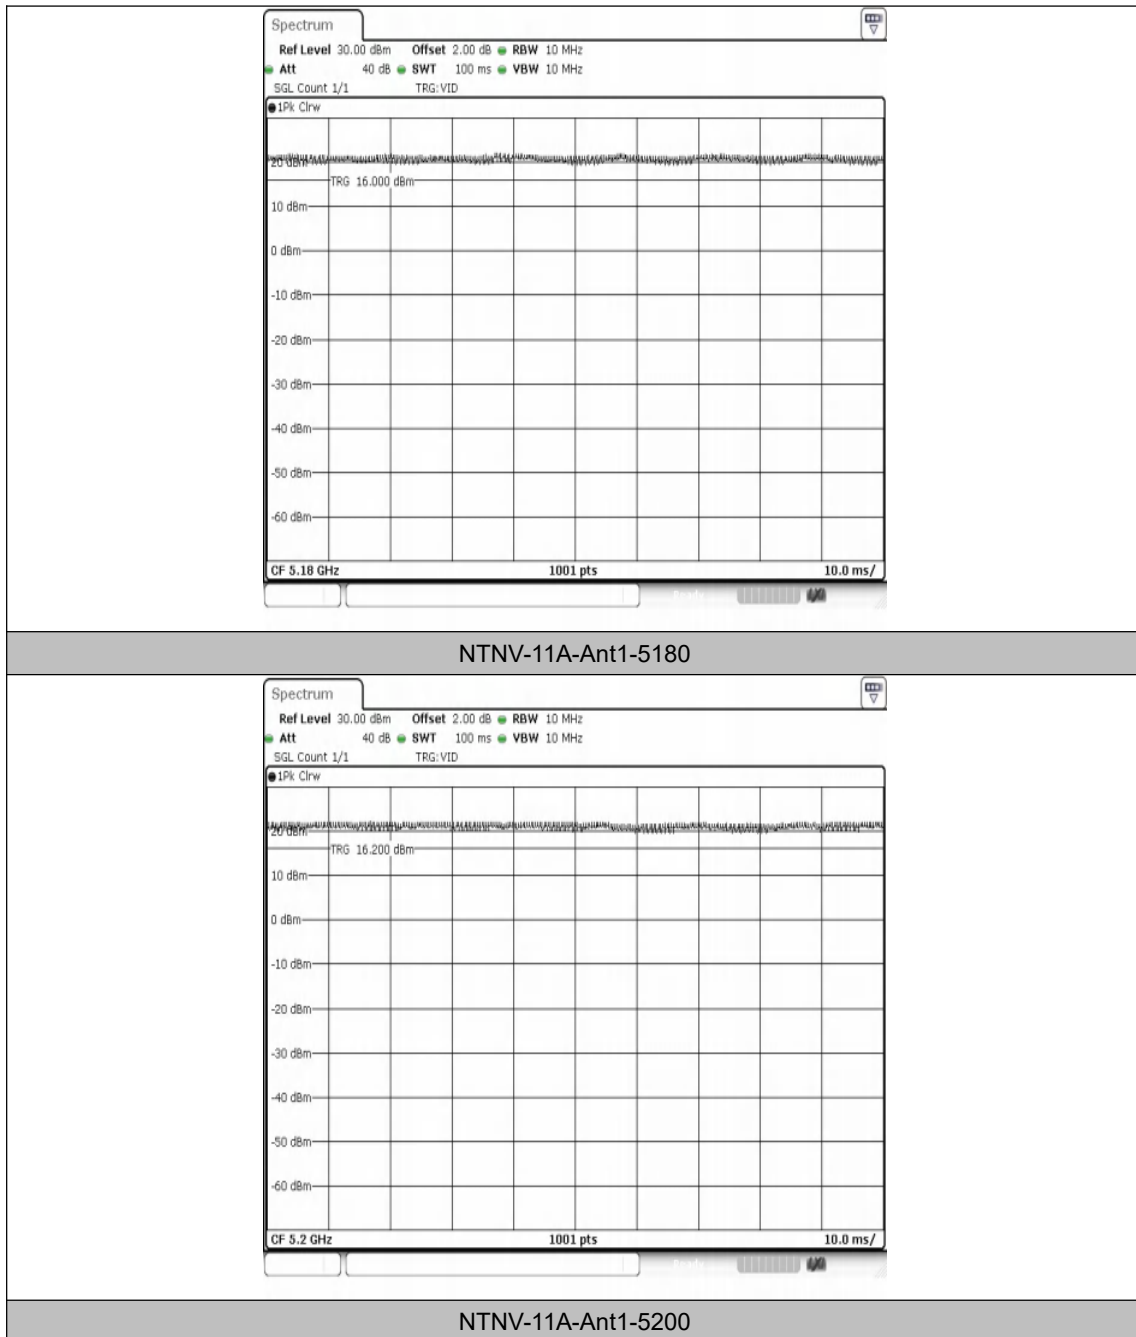


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

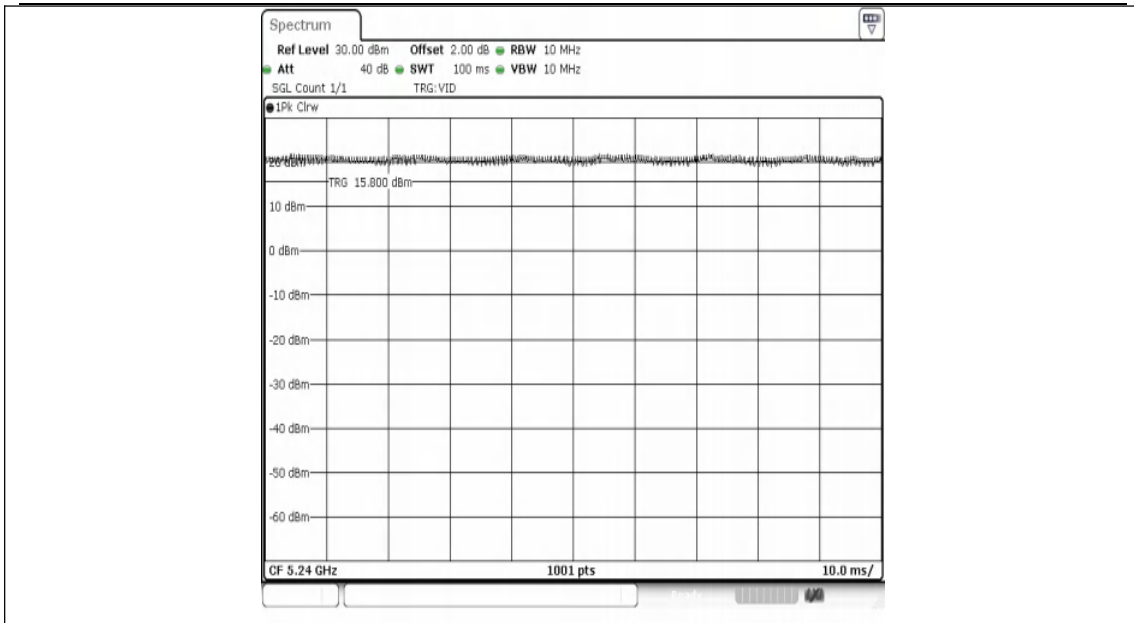


NTNV-11A-Ant1-5240

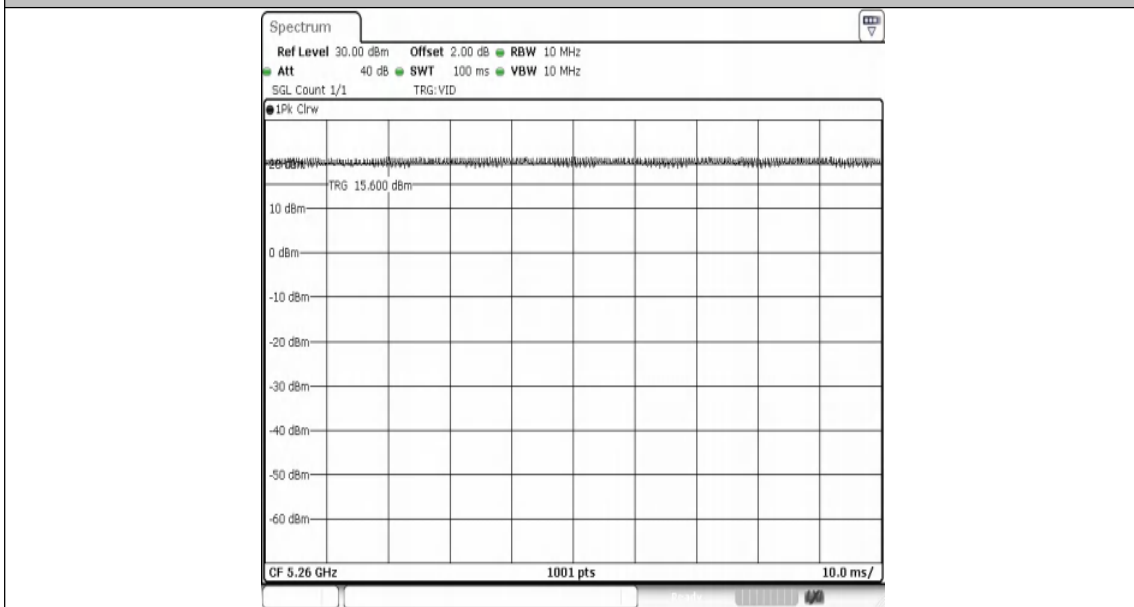


NTNV-11A-Ant1-5260

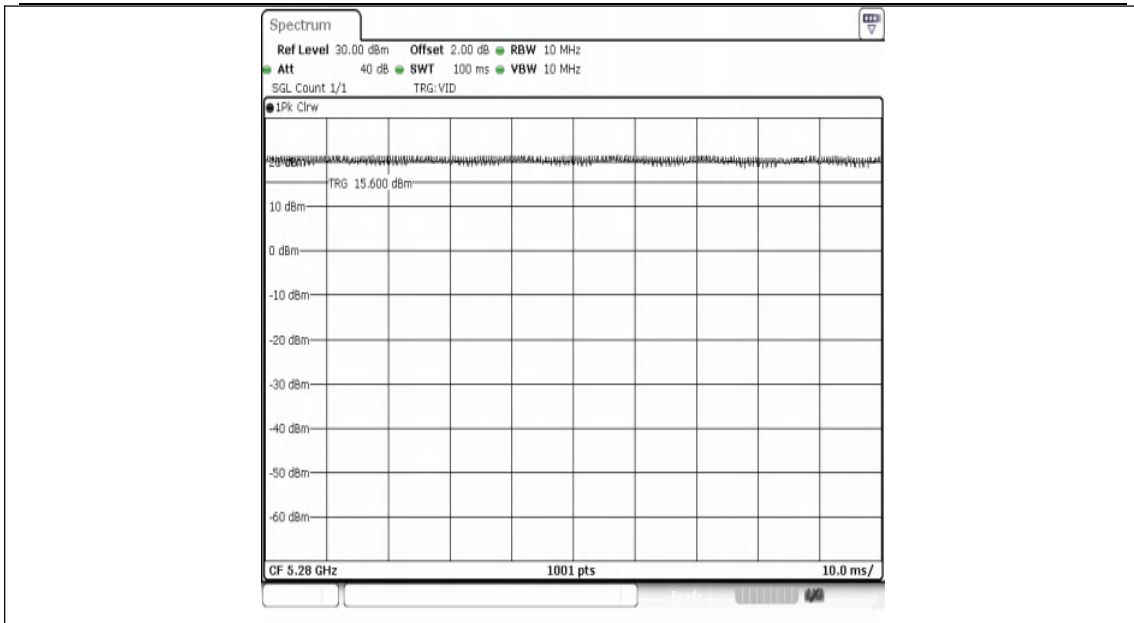

NTNV-11A-Ant1-5280

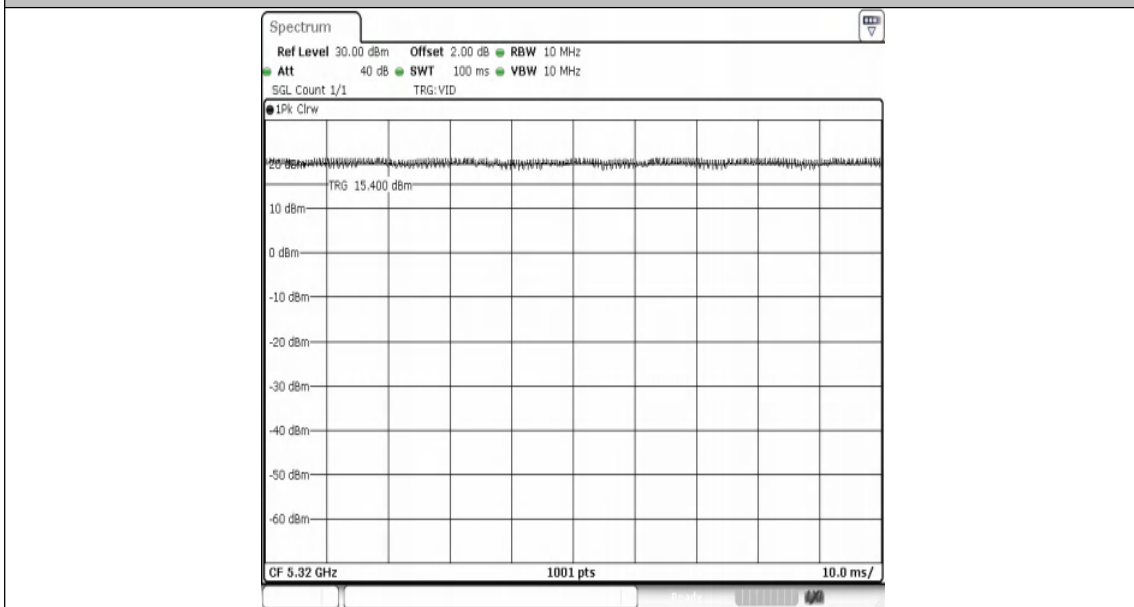


NTNV-11A-Ant1-5320

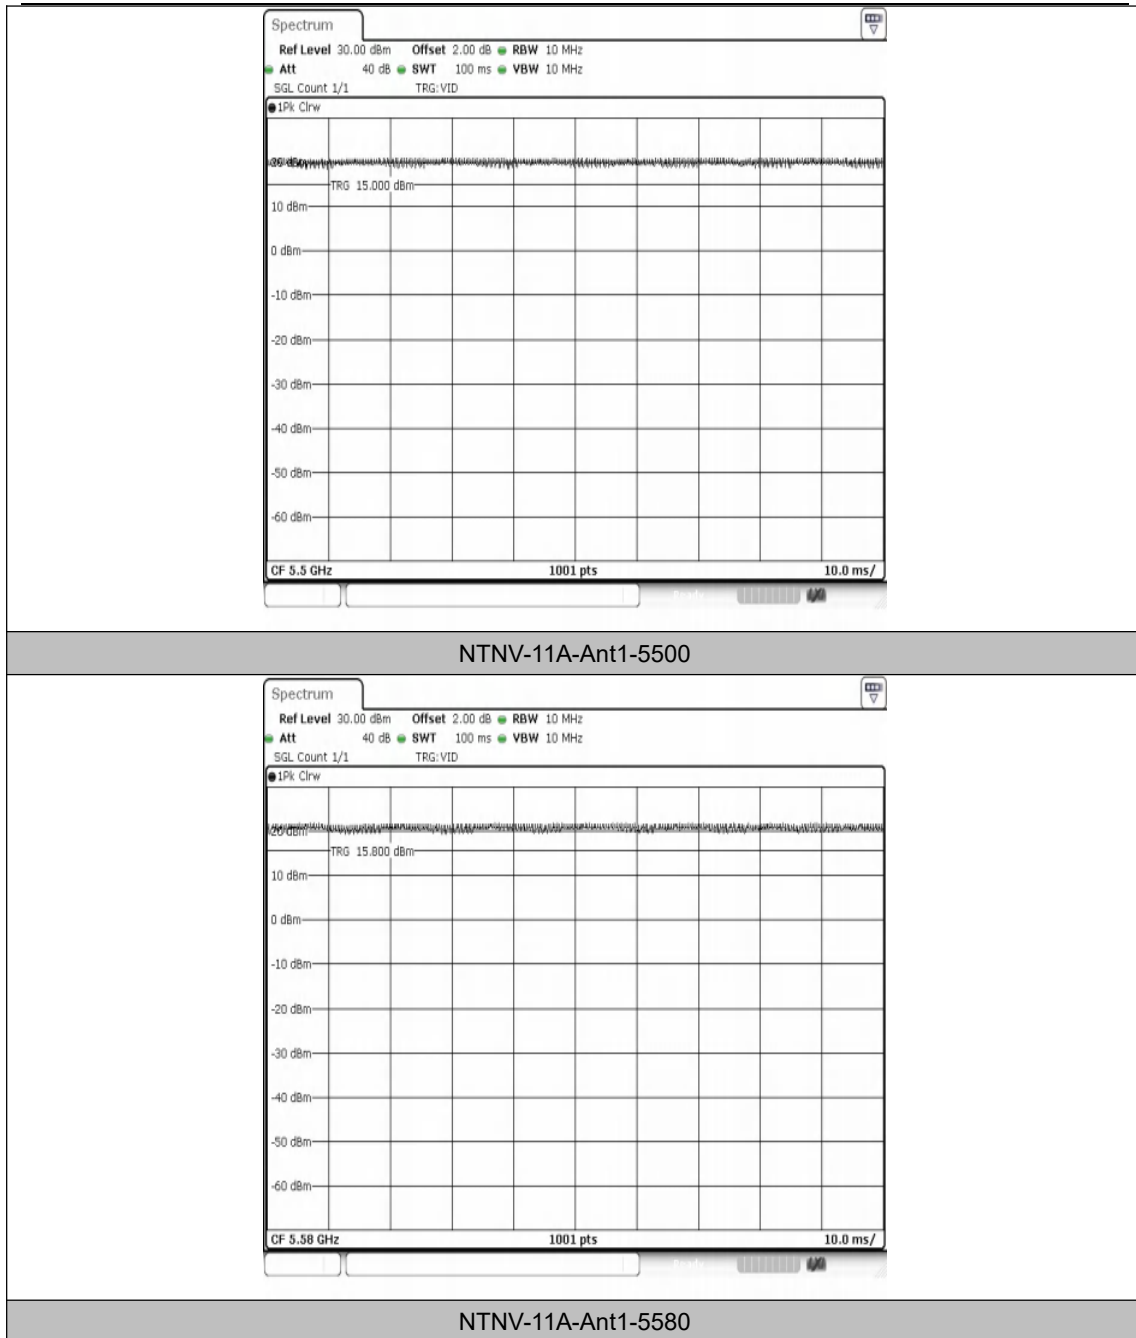


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

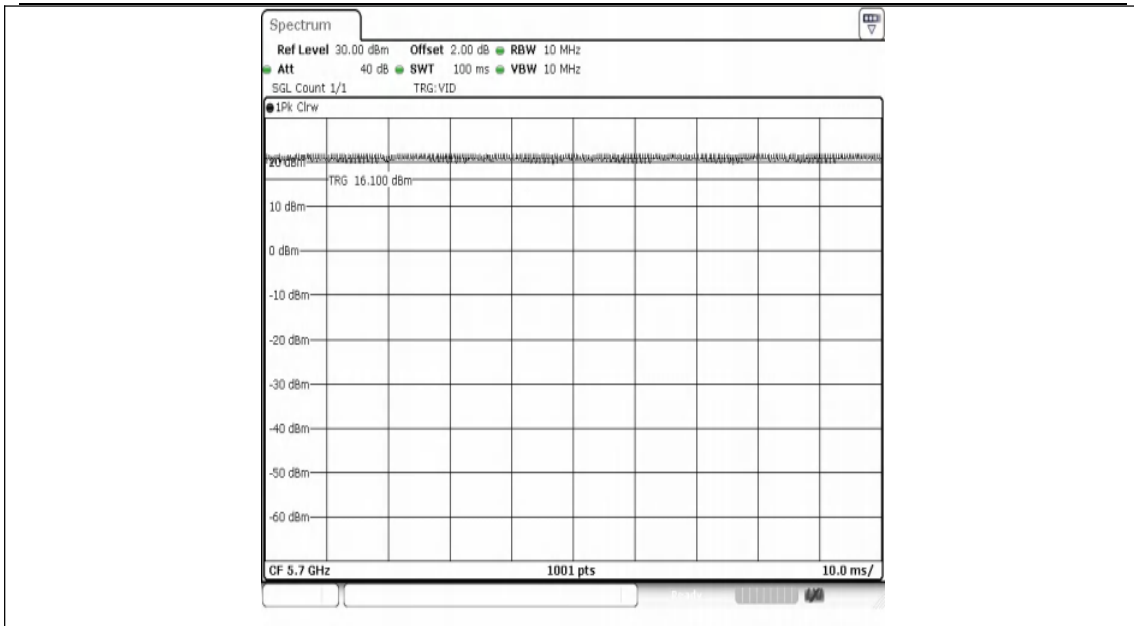

NTNV-11A-Ant1-5700

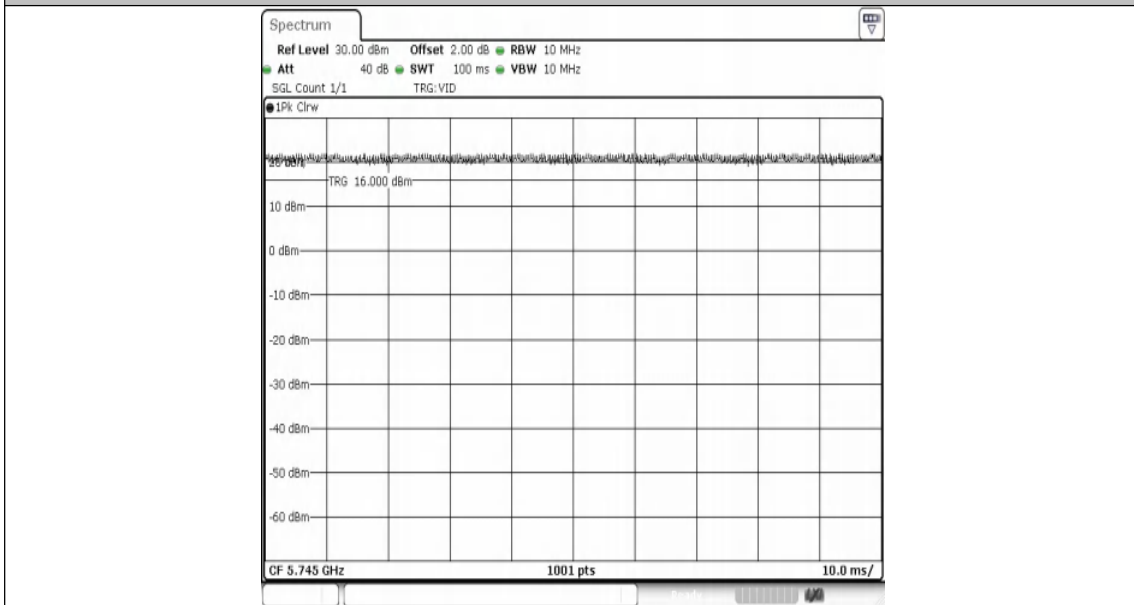


NTNV-11A-Ant1-5745

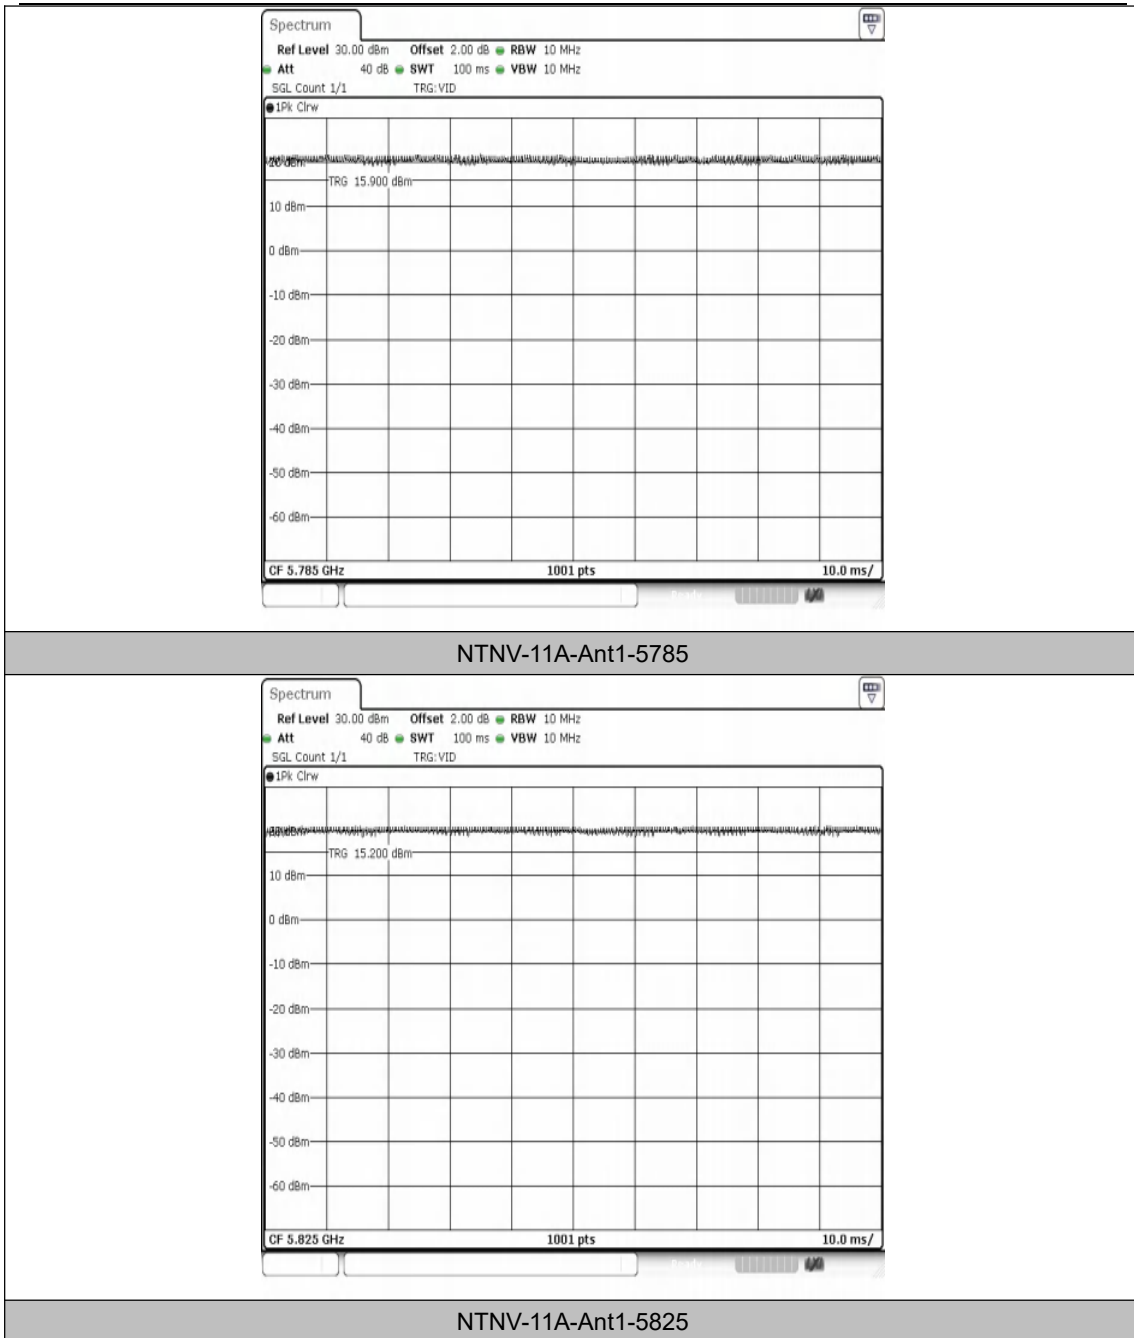


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

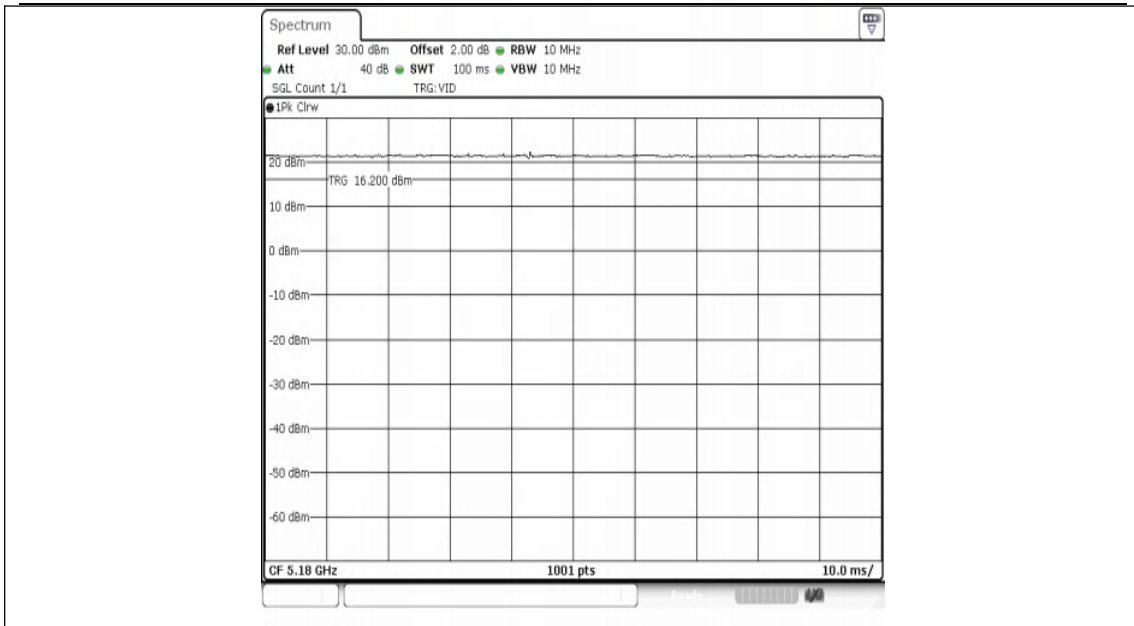

NTNV-11N20SISO-Ant1-5180

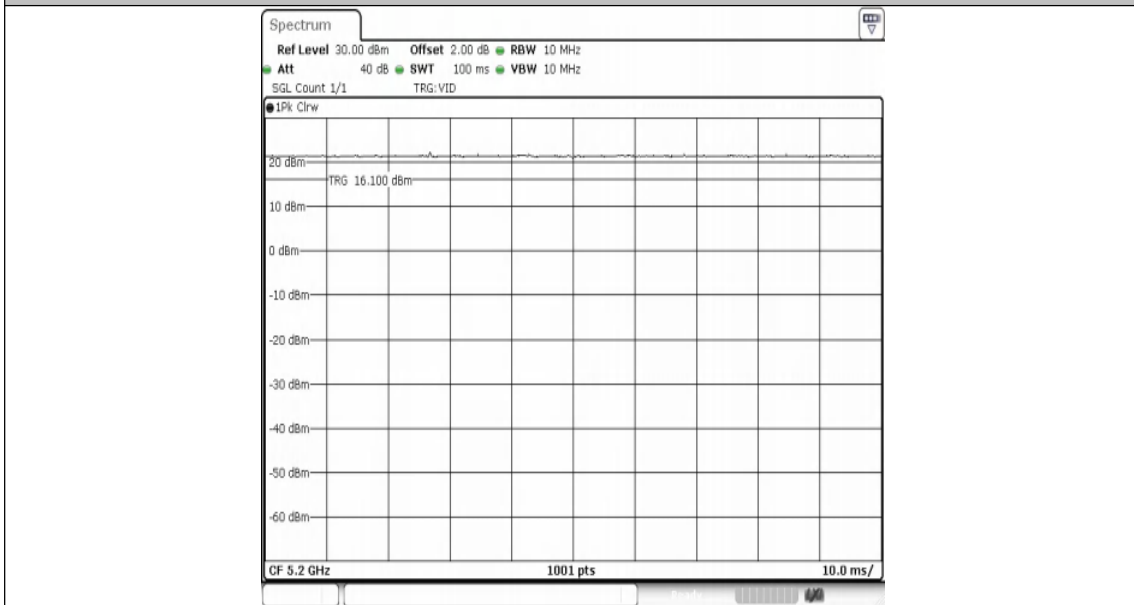


NTNV-11N20SISO-Ant1-5200

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

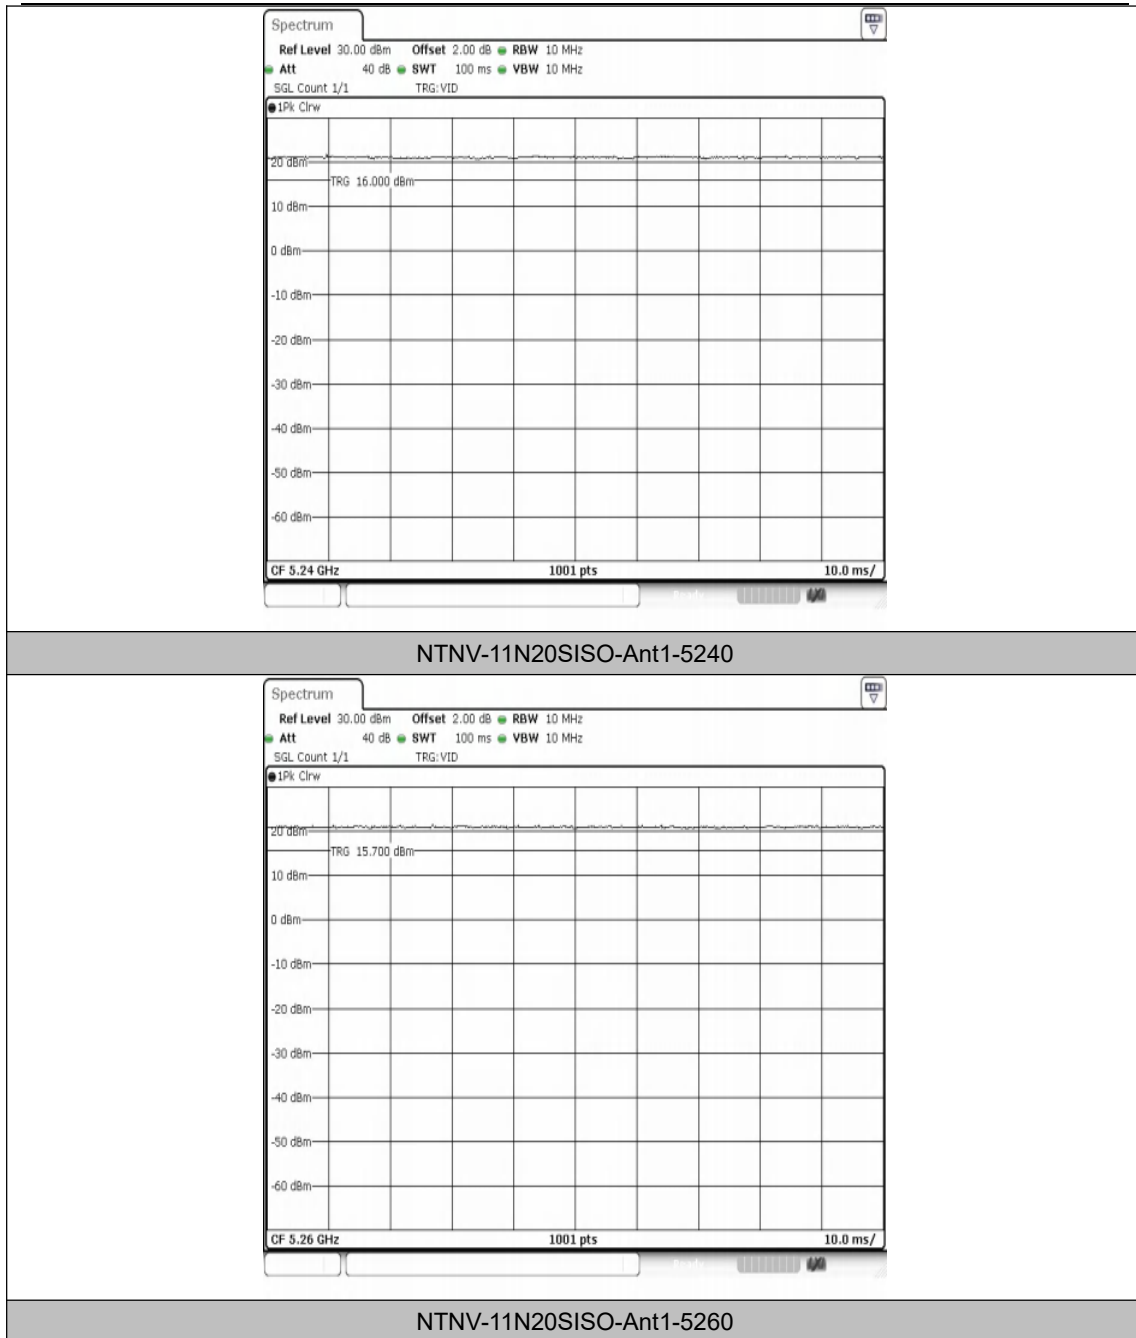

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

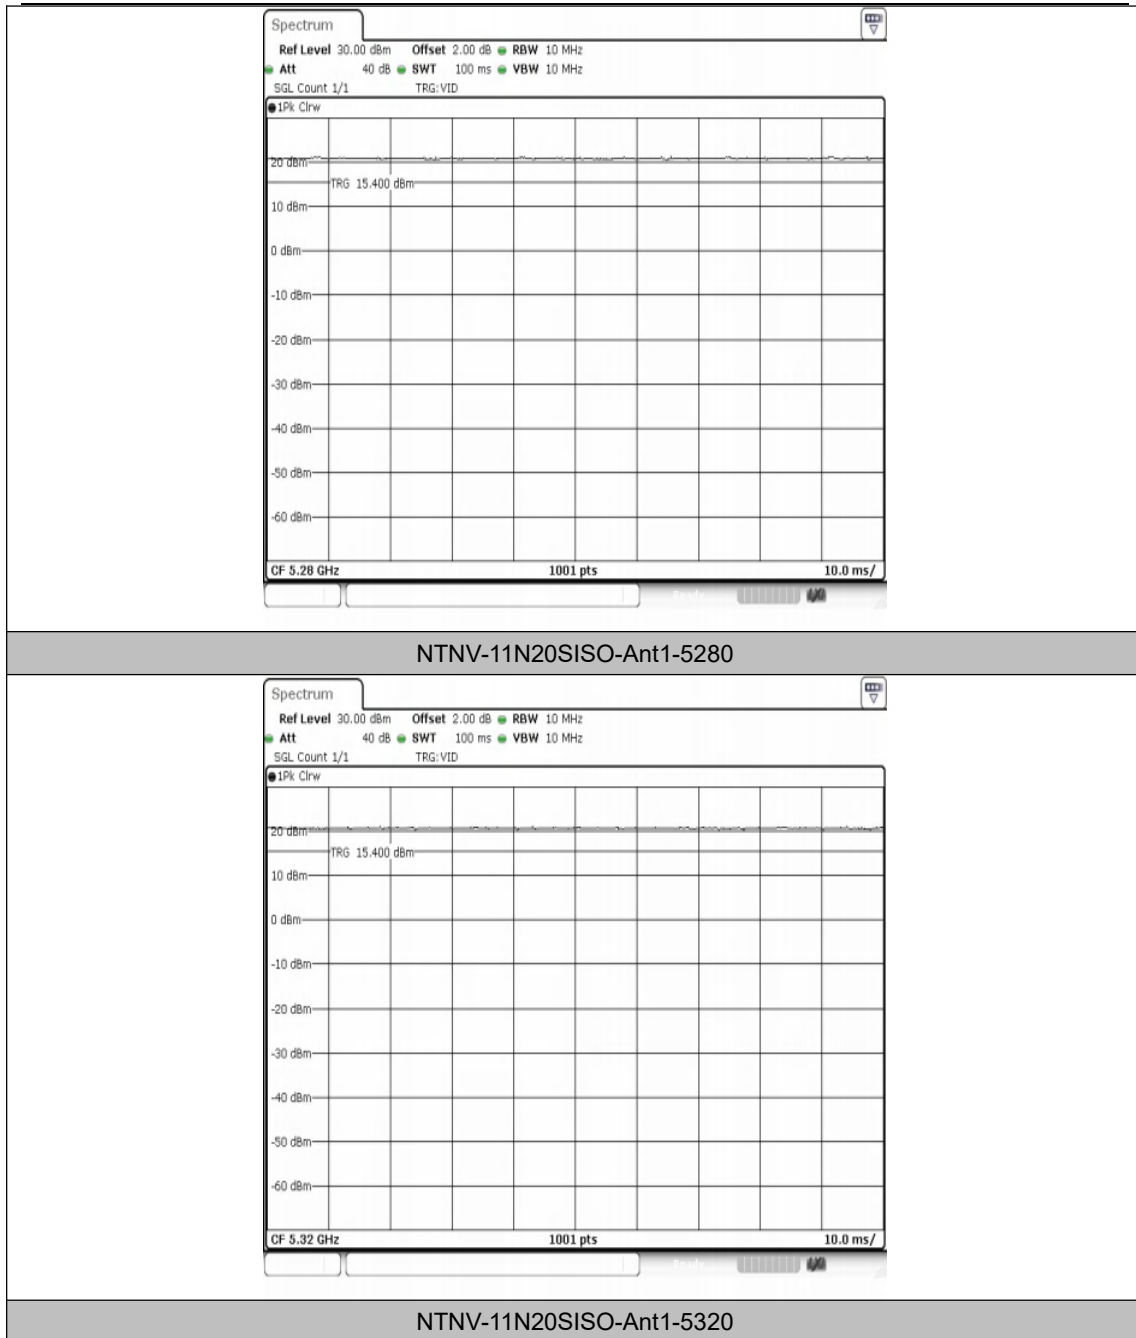

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

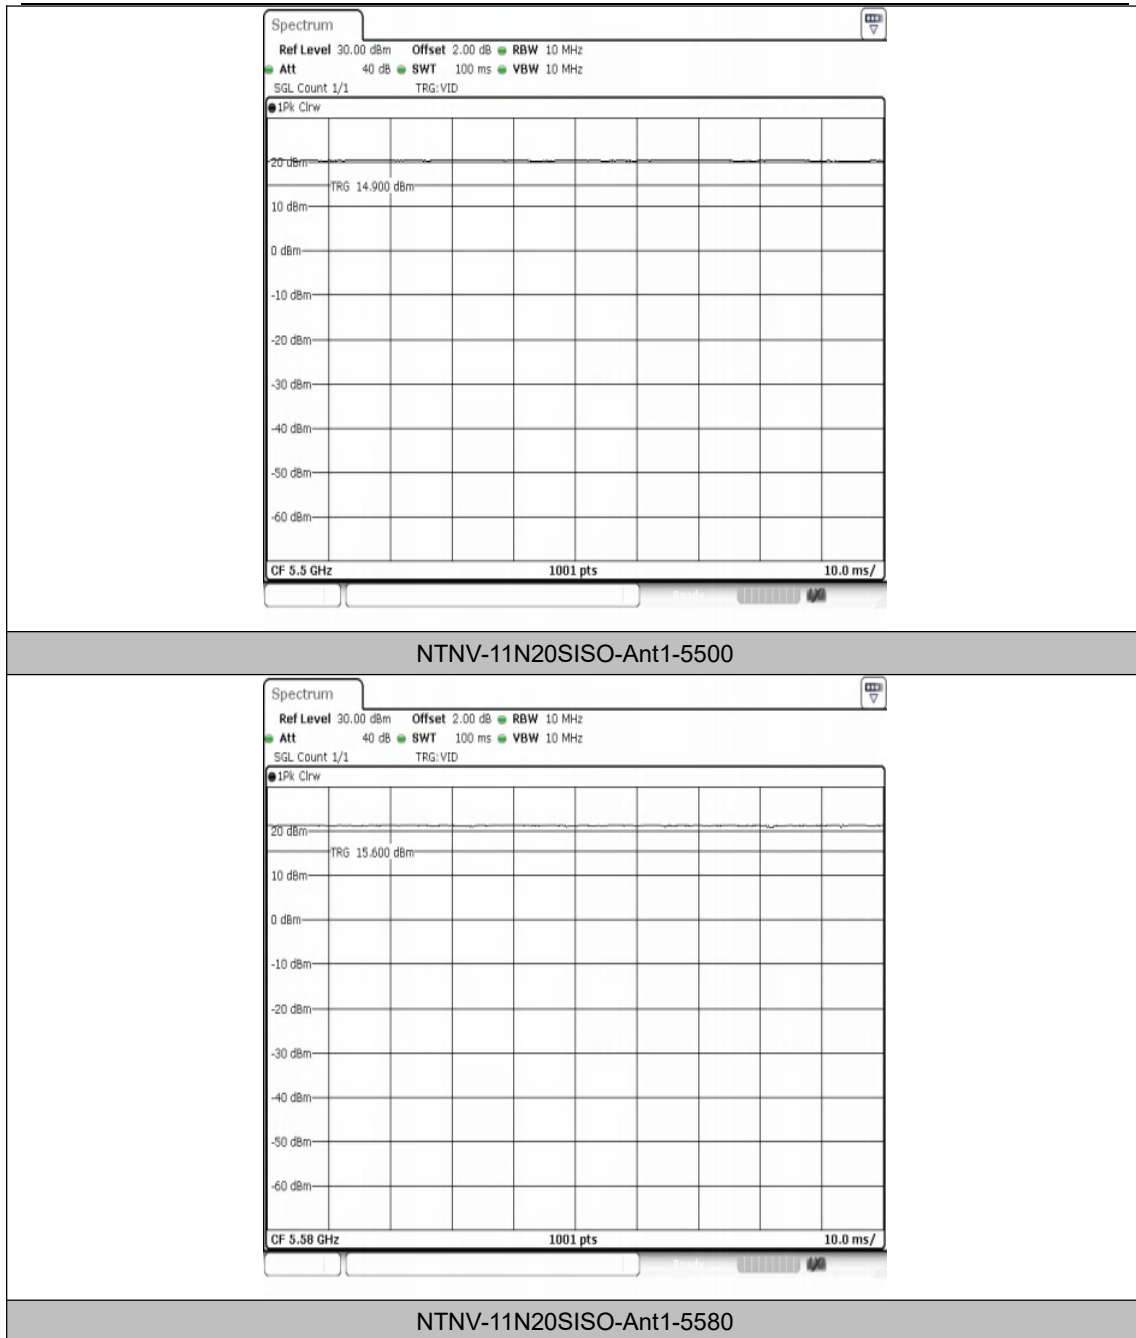


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

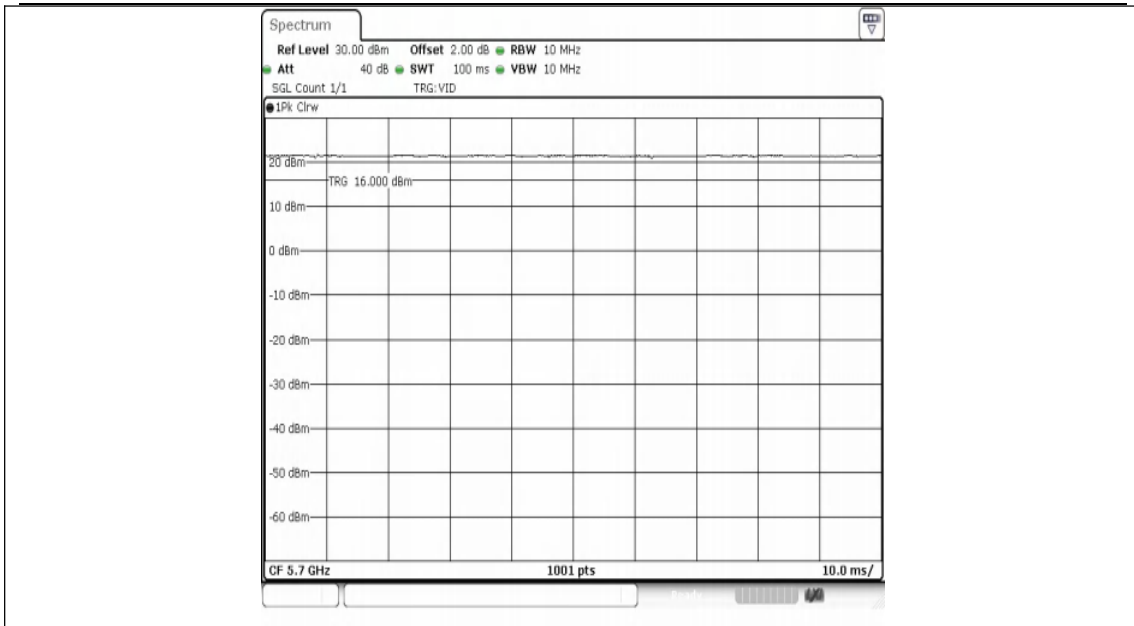

NTNV-11N20SISO-Ant1-5700

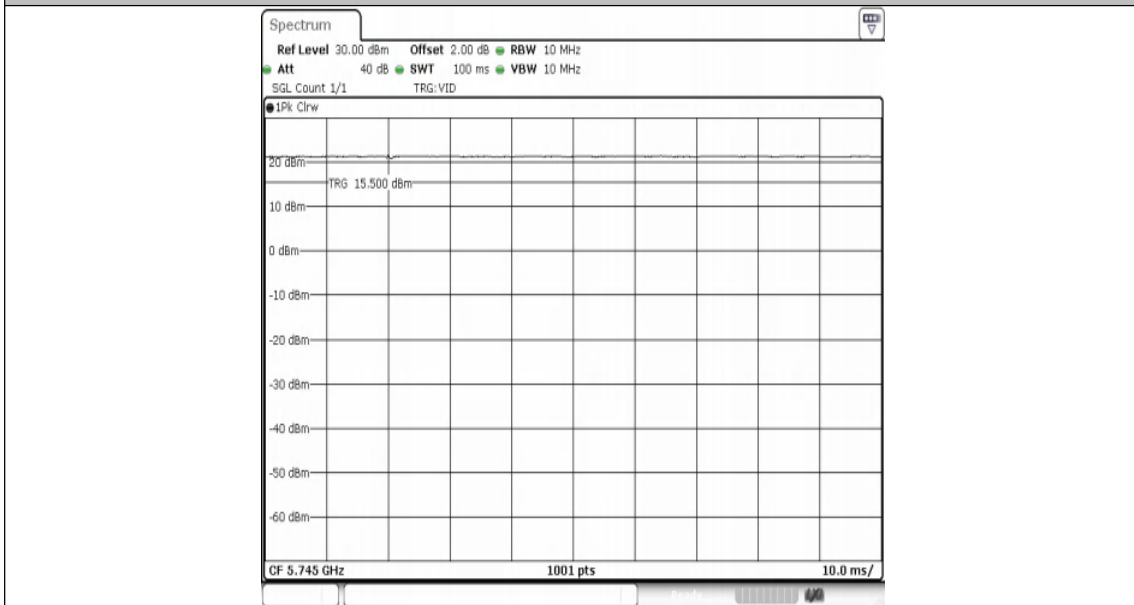


NTNV-11N20SISO-Ant1-5745

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

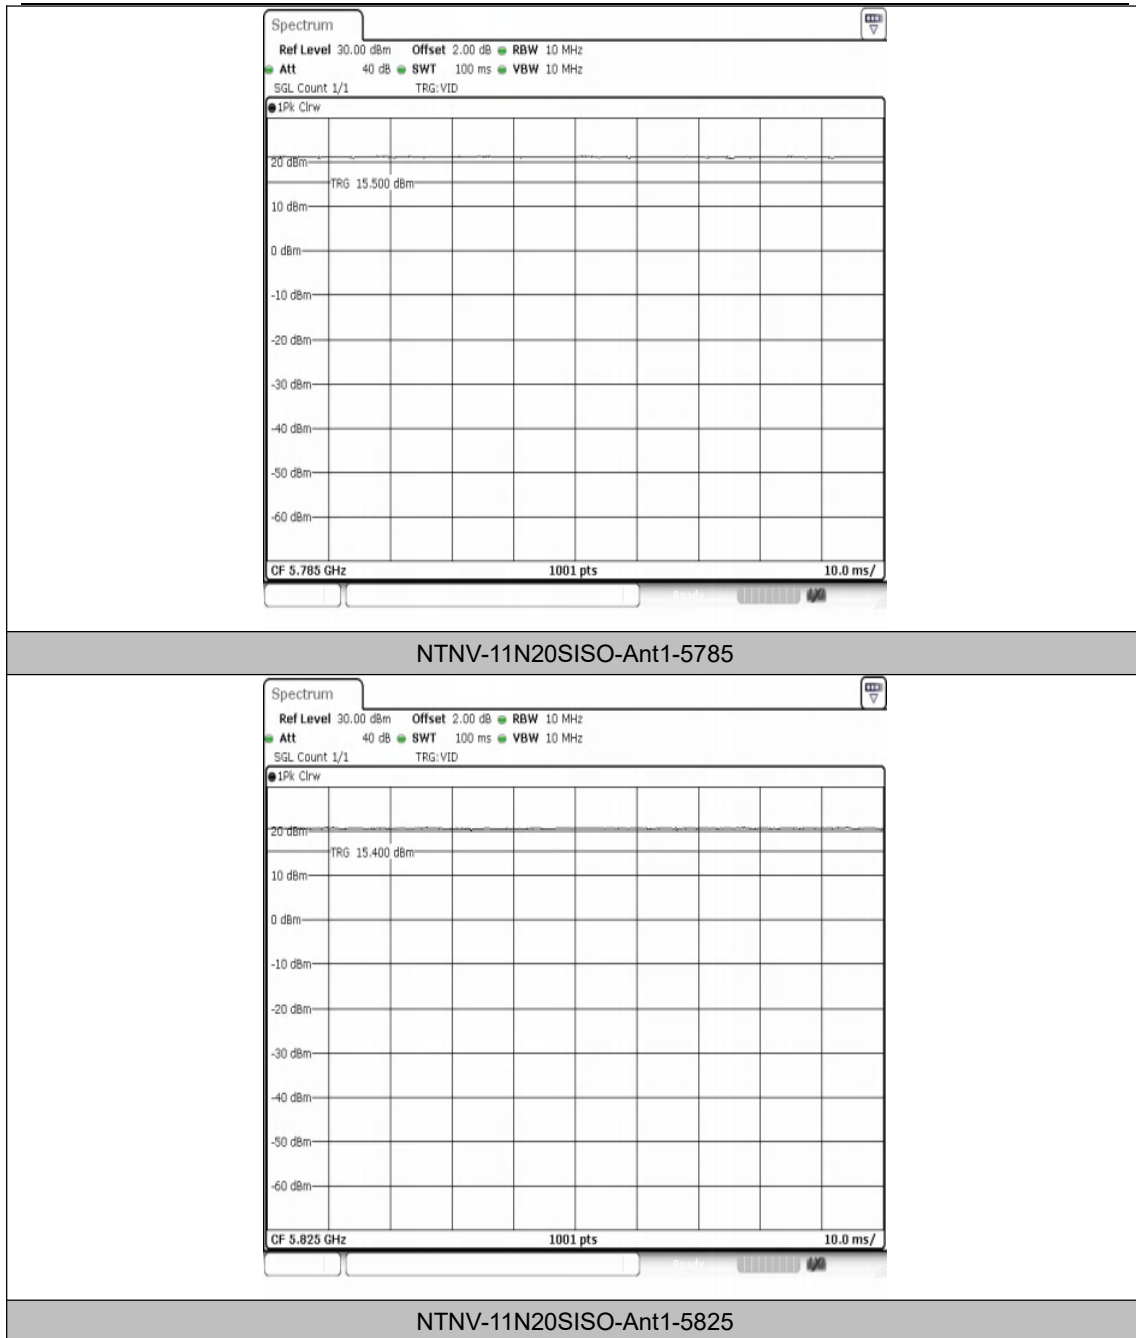


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

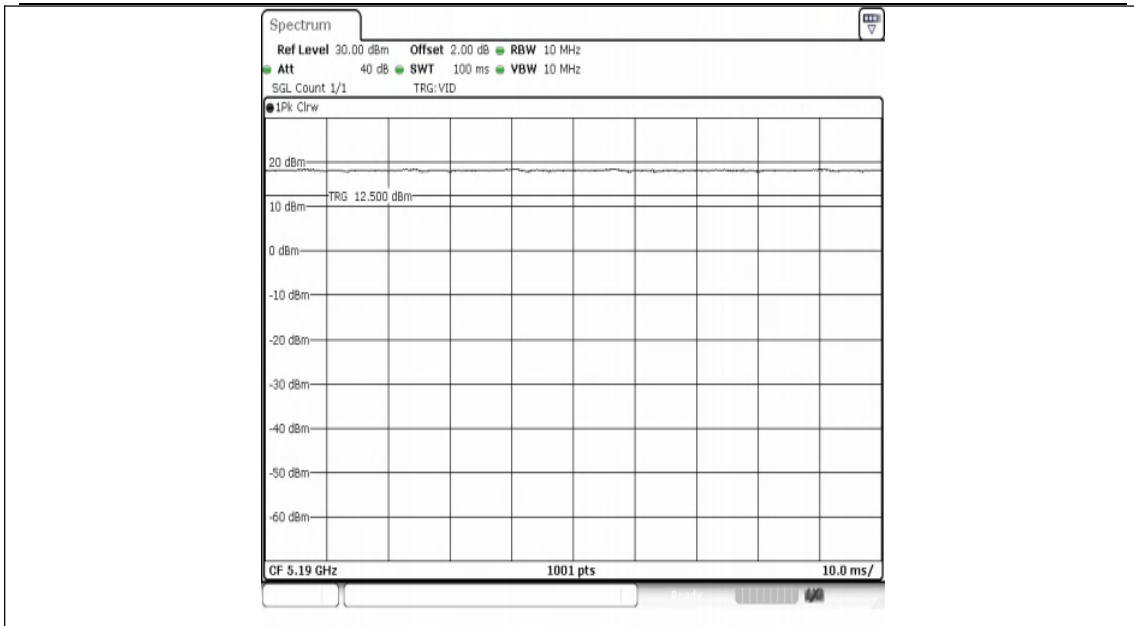

NTNV-11N40SISO-Ant1-5190

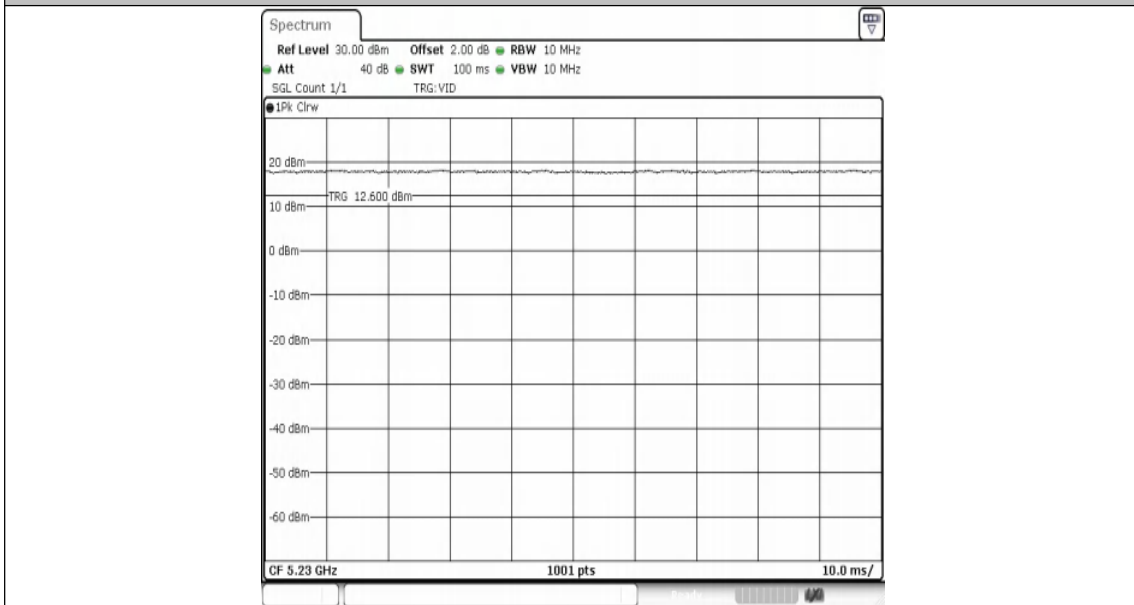


NTNV-11N40SISO-Ant1-5230


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

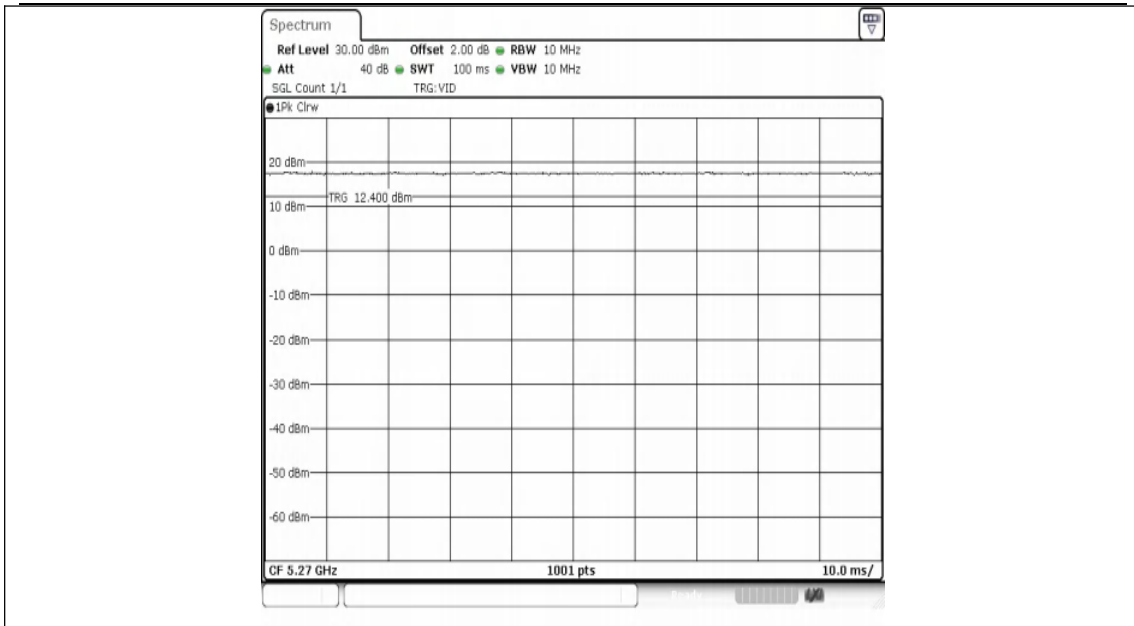

NTNV-11N40SISO-Ant1-5270

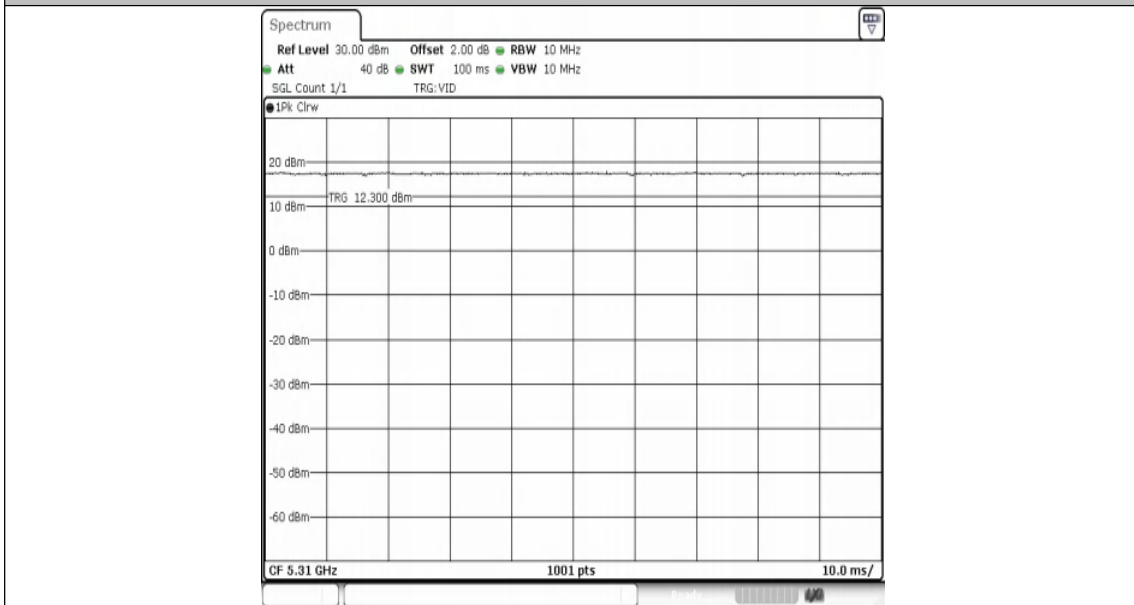


NTNV-11N40SISO-Ant1-5310

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

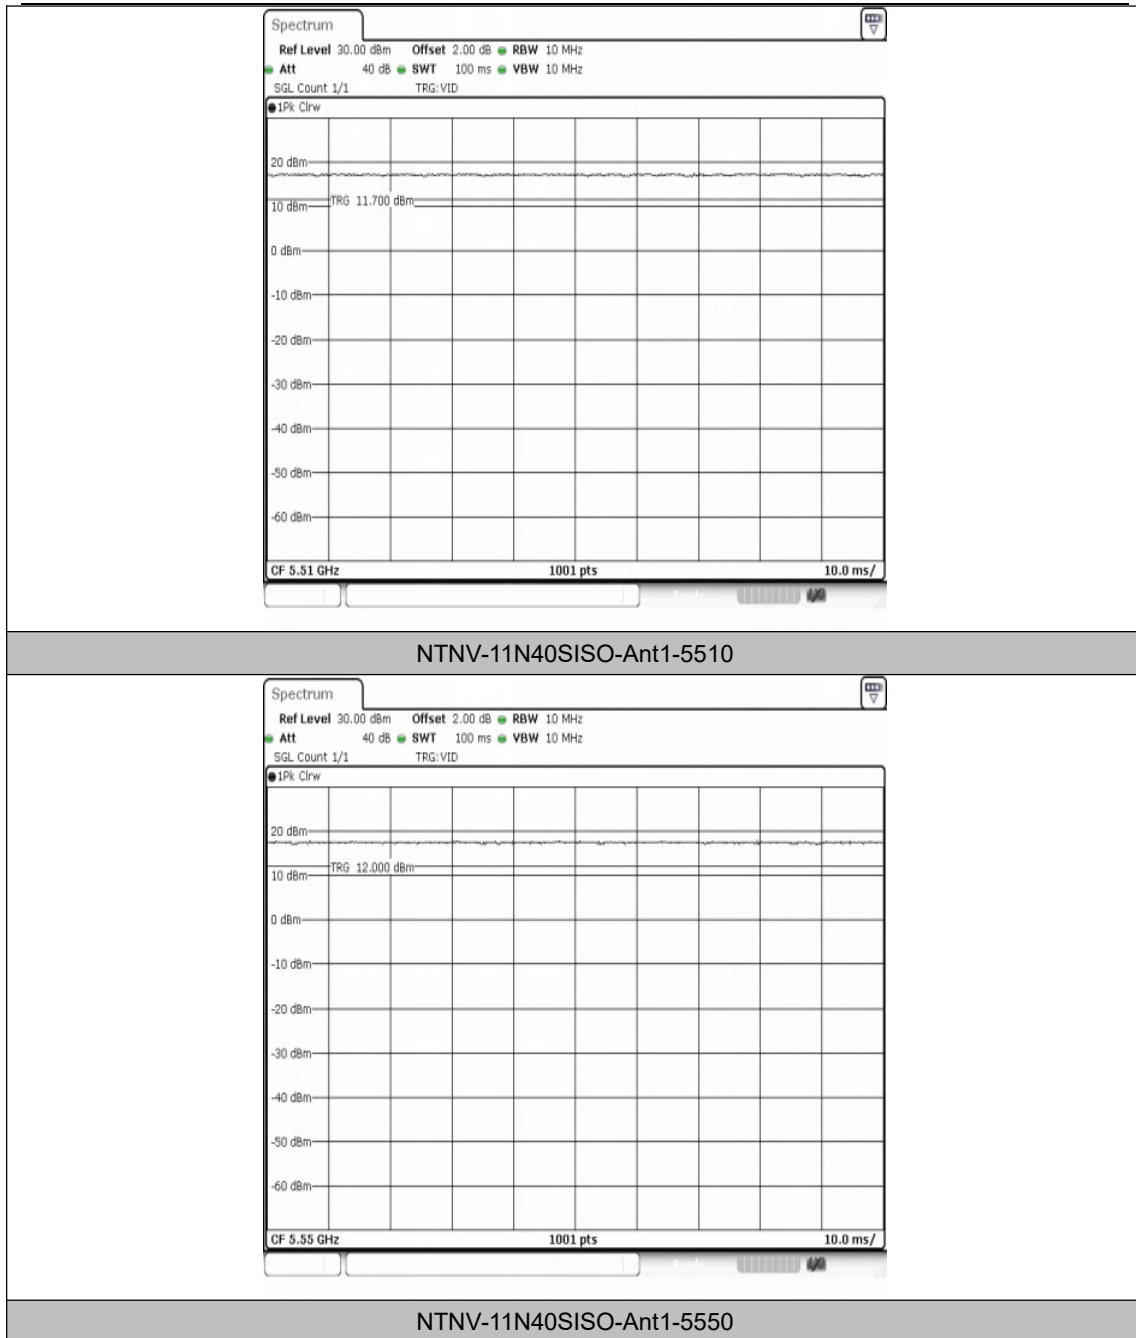


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

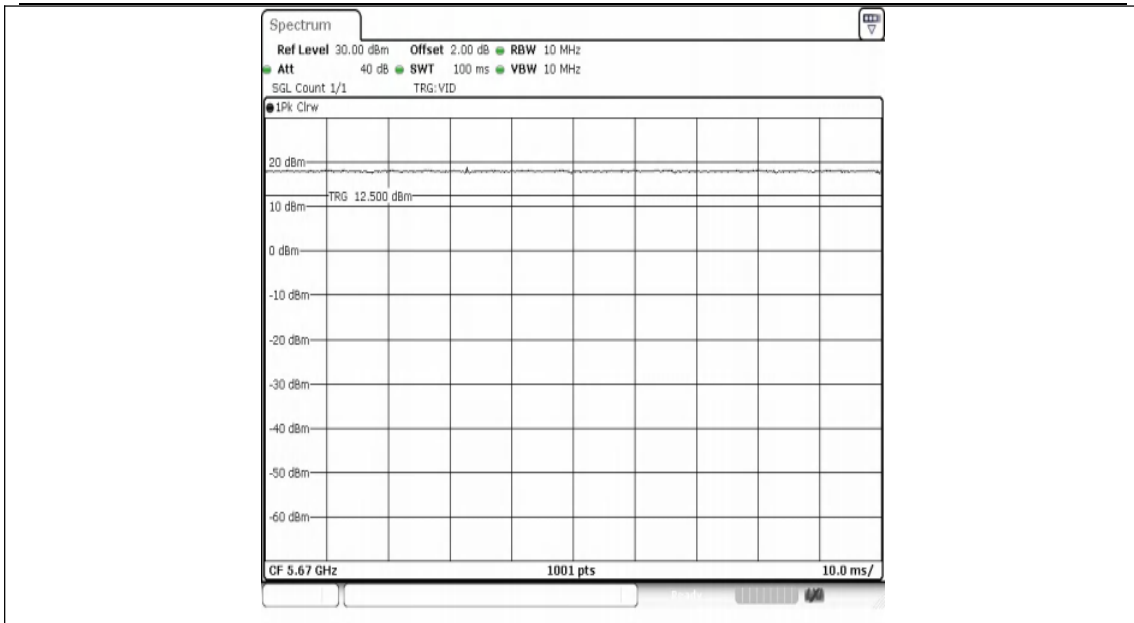


NTNV-11N40SISO-Ant1-5670

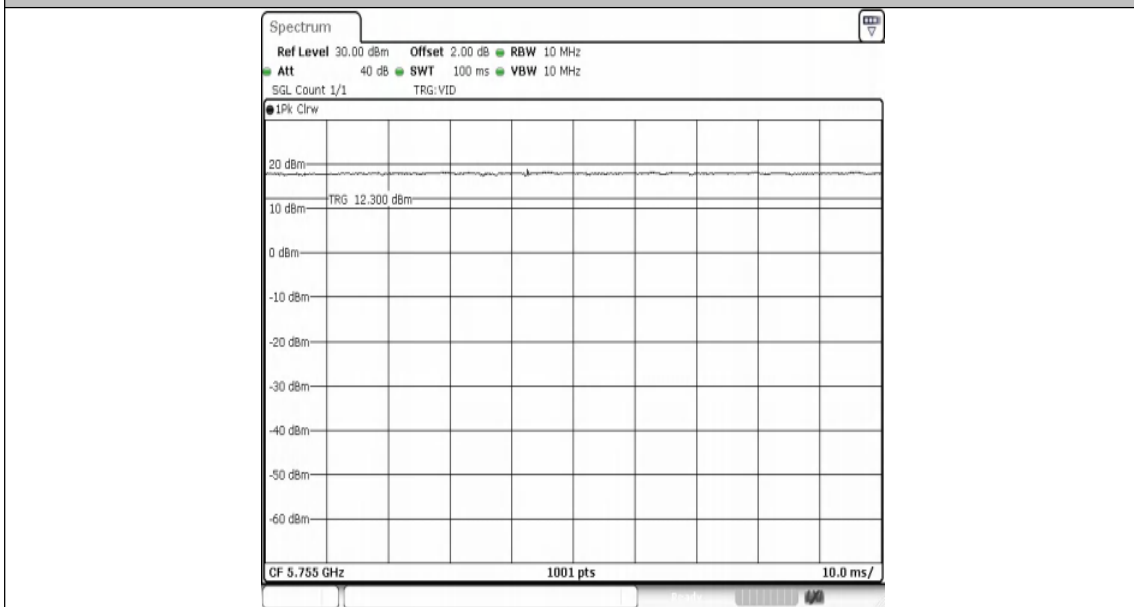

NTNV-11N40SISO-Ant1-5755

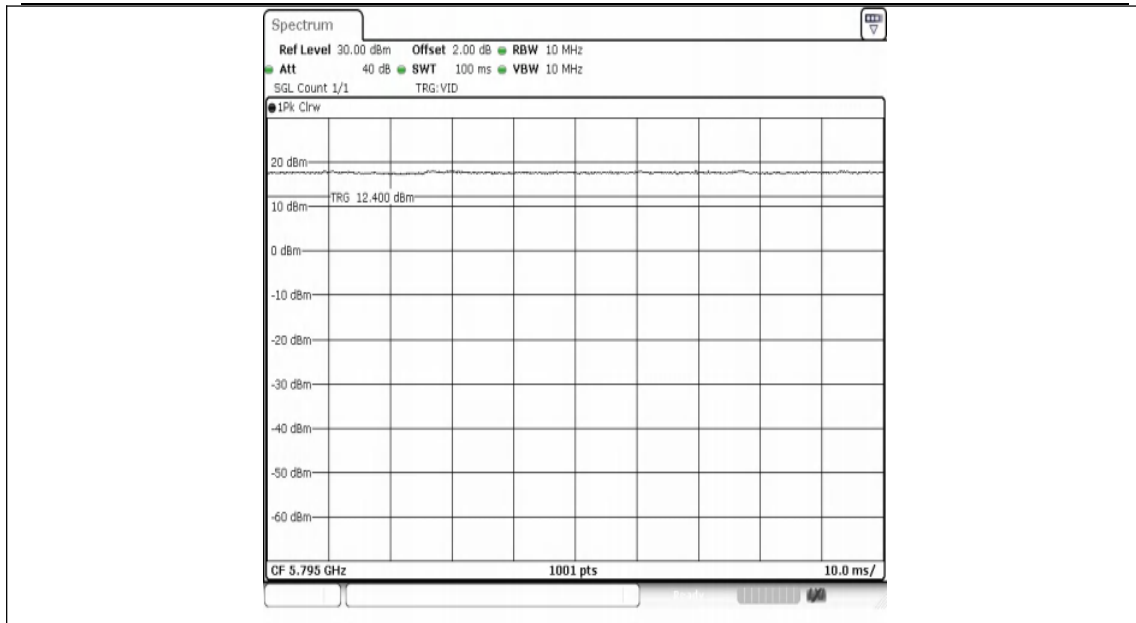

NTNV-11N40SISO-Ant1-5795

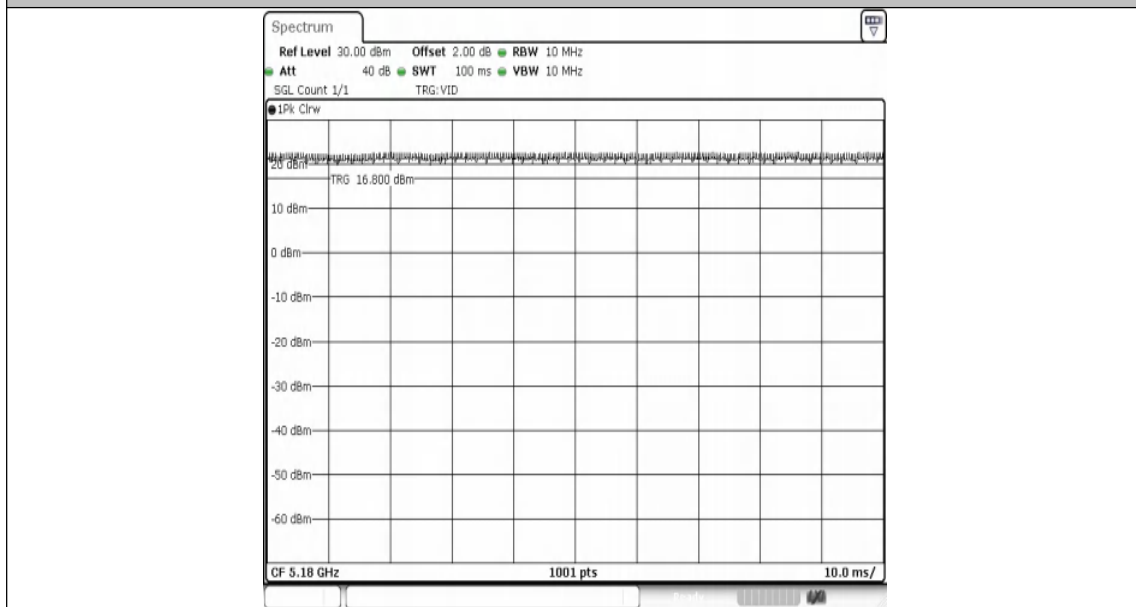


NTNV-11AC20SISO-Ant1-5180

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

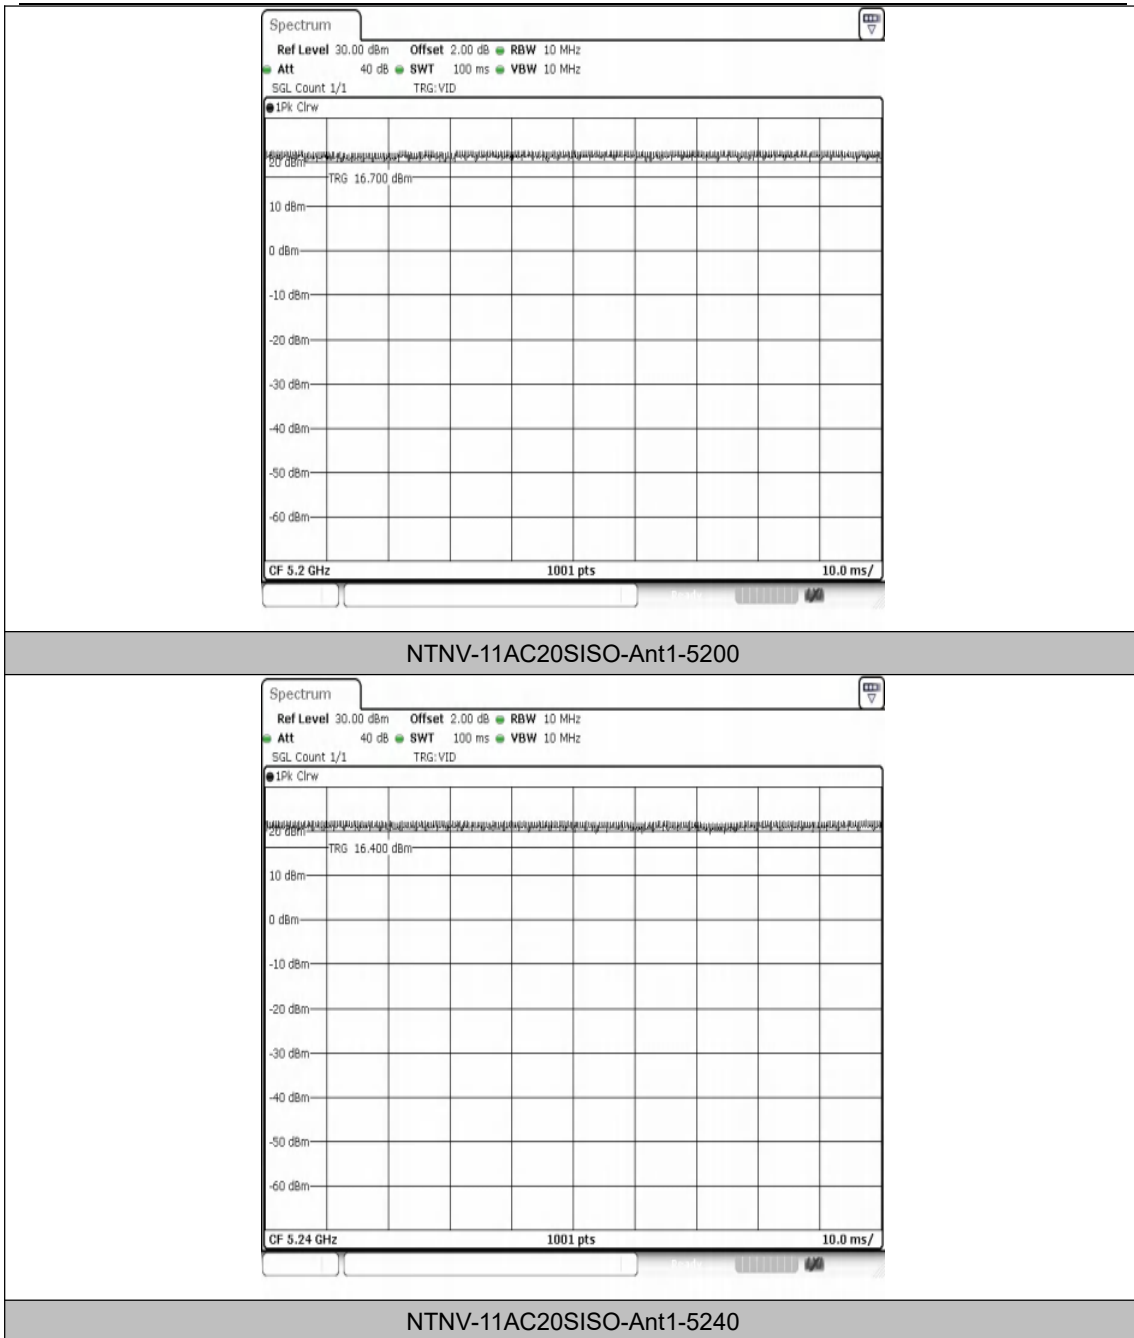

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

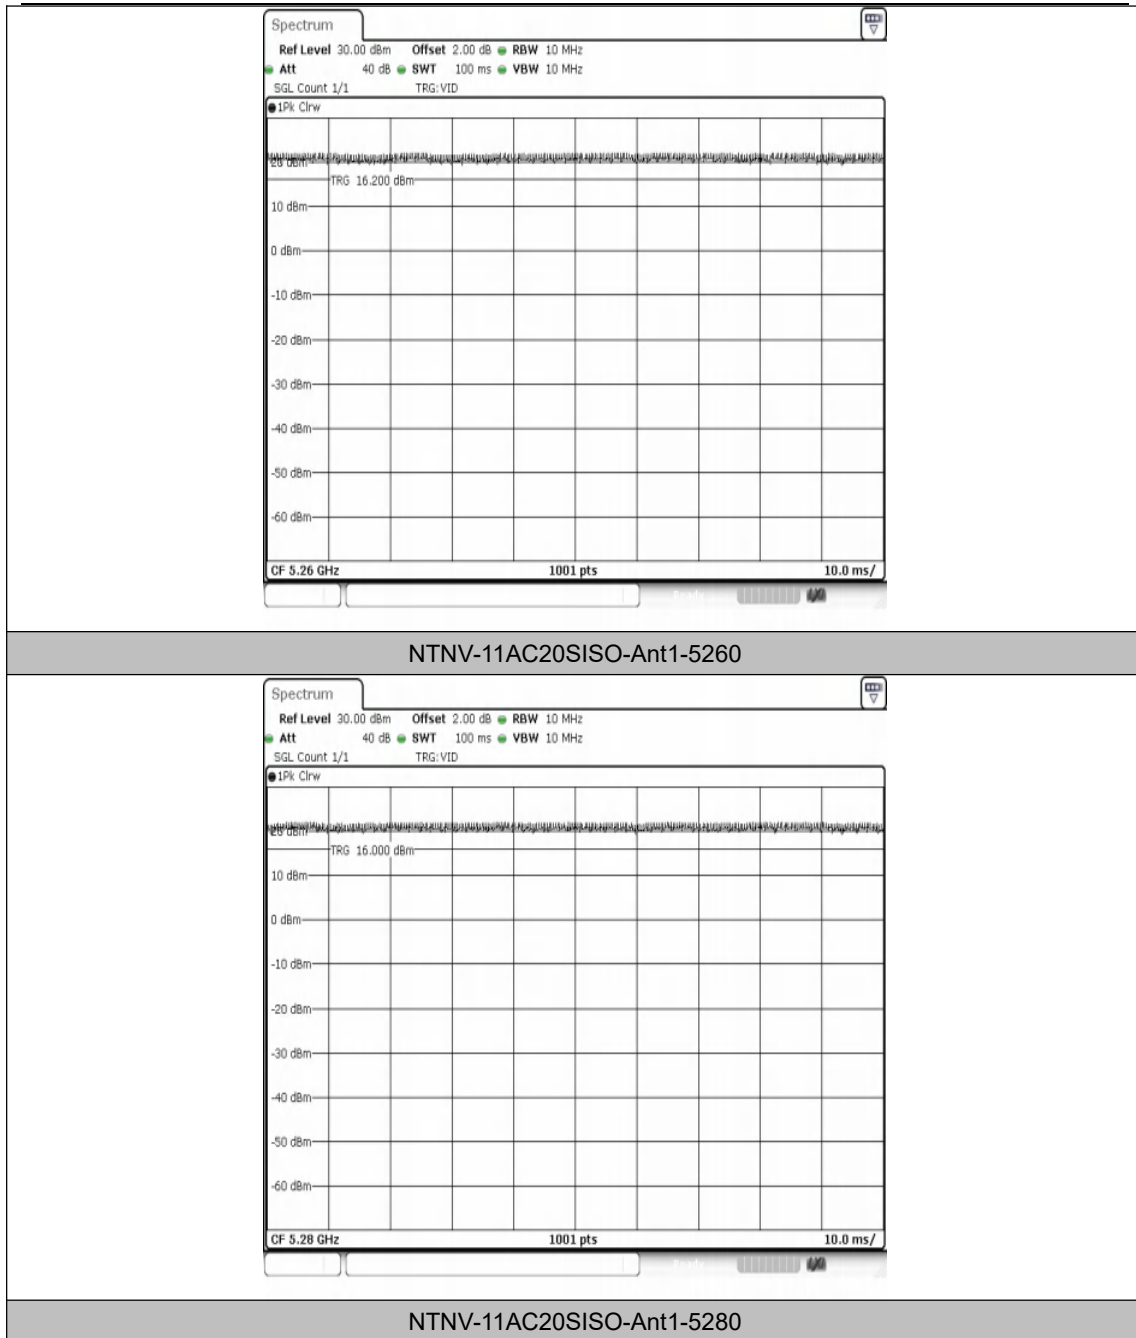

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

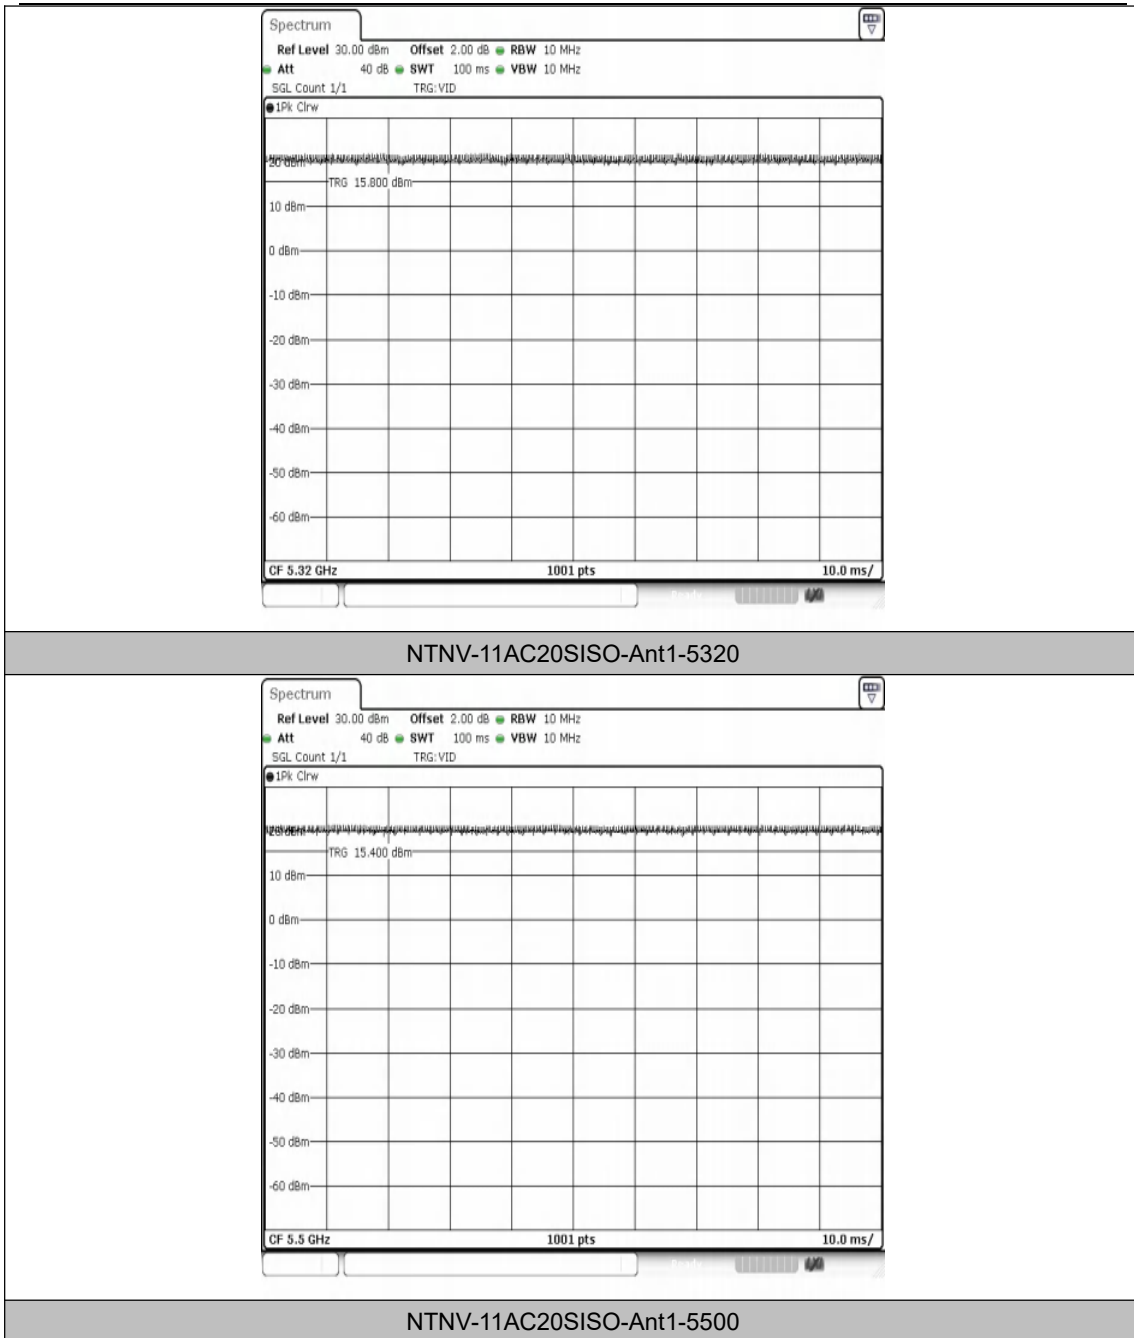

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

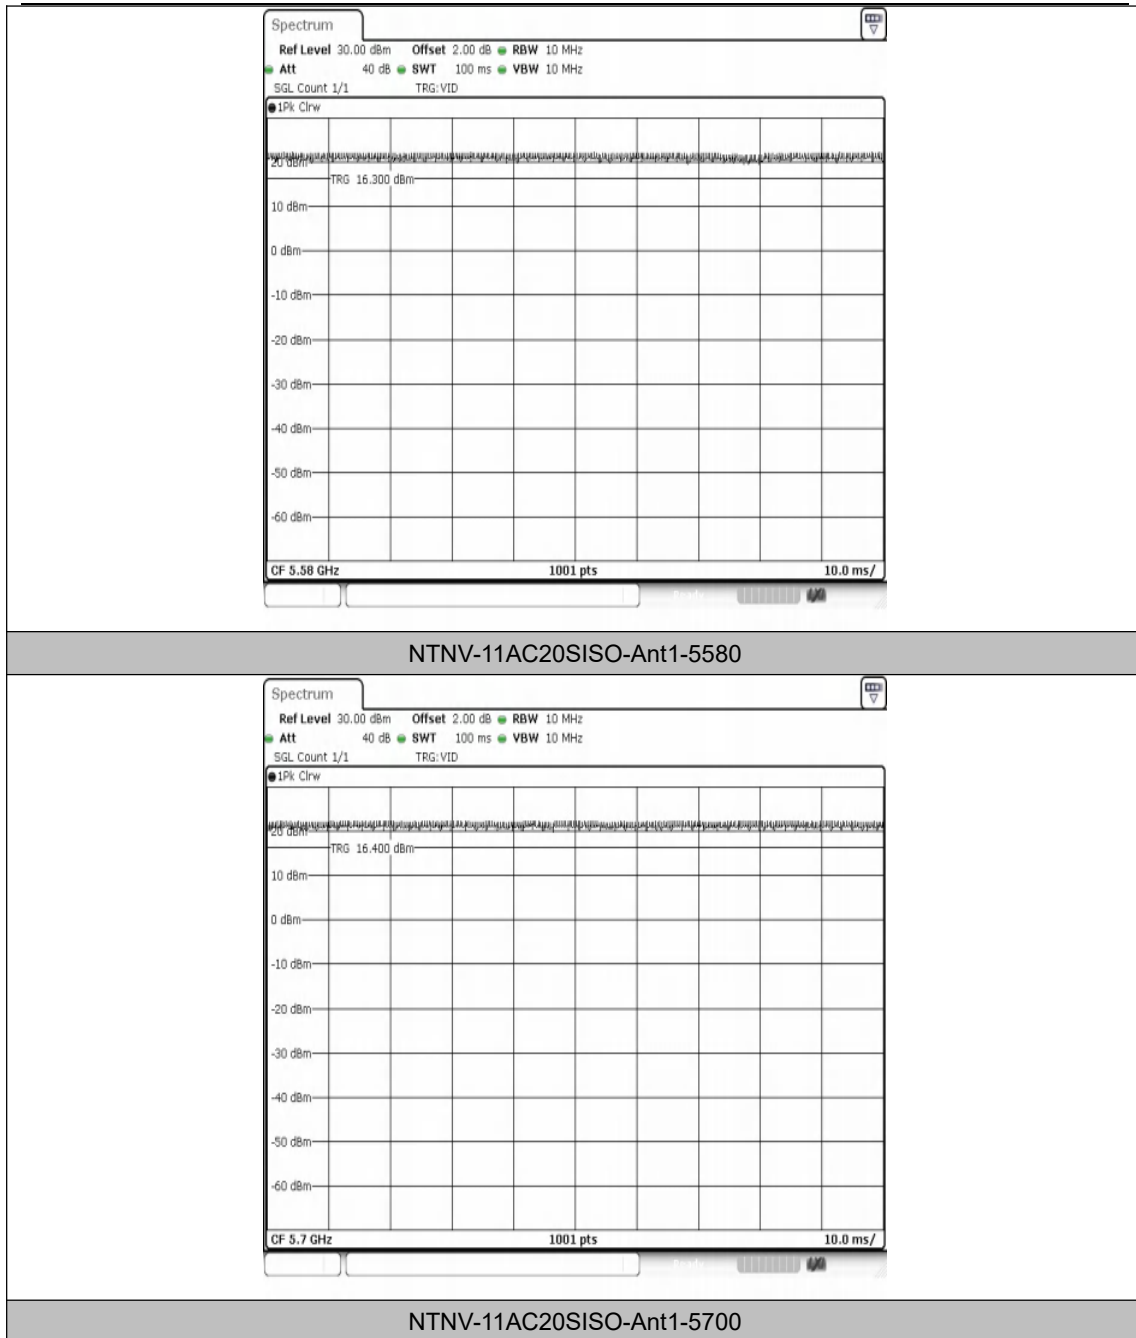


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

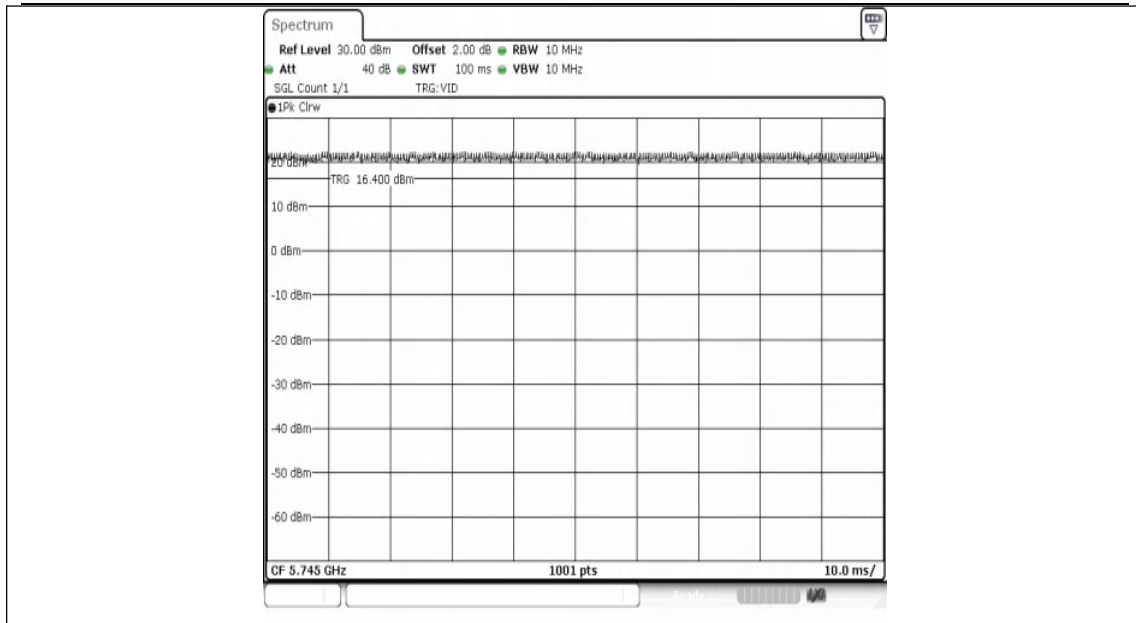

NTNV-11AC20SISO-Ant1-5745

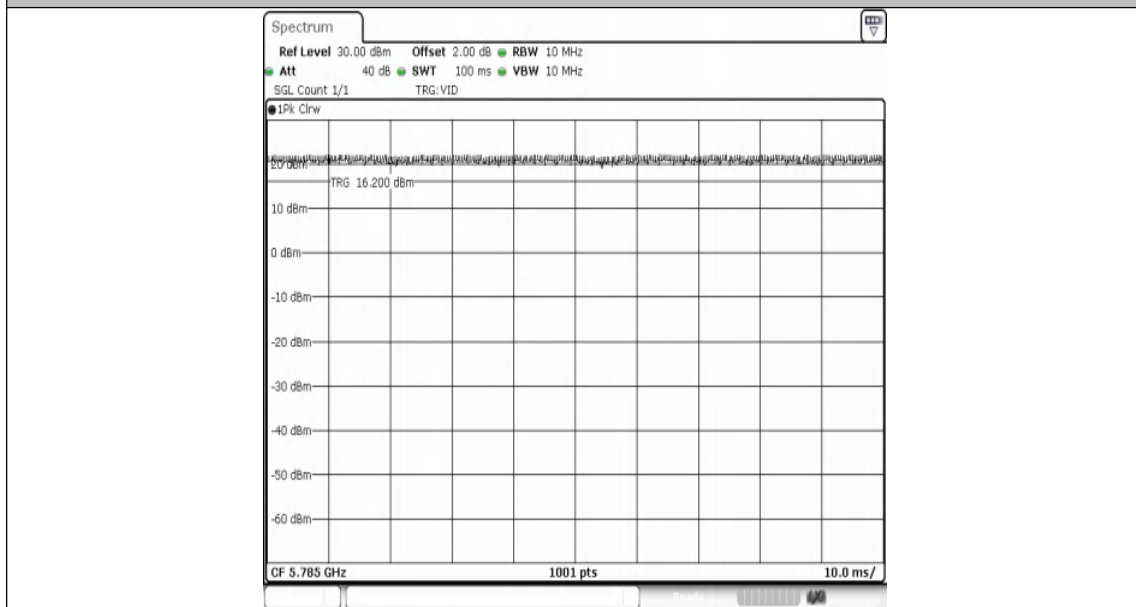


NTNV-11AC20SISO-Ant1-5785


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

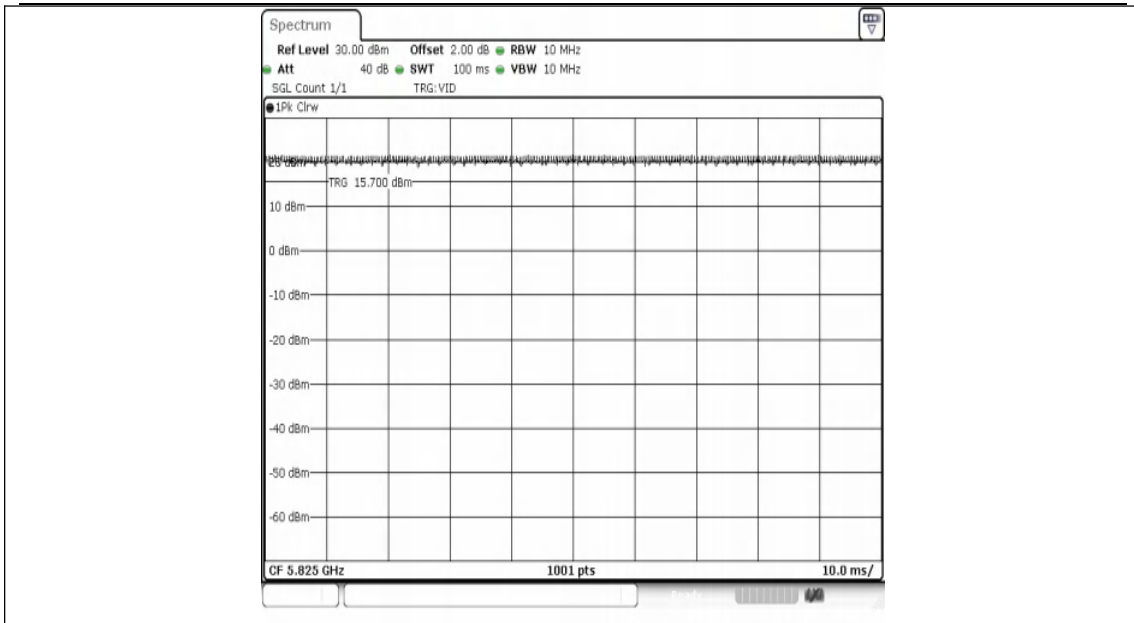

NTNV-11AC20SISO-Ant1-5825

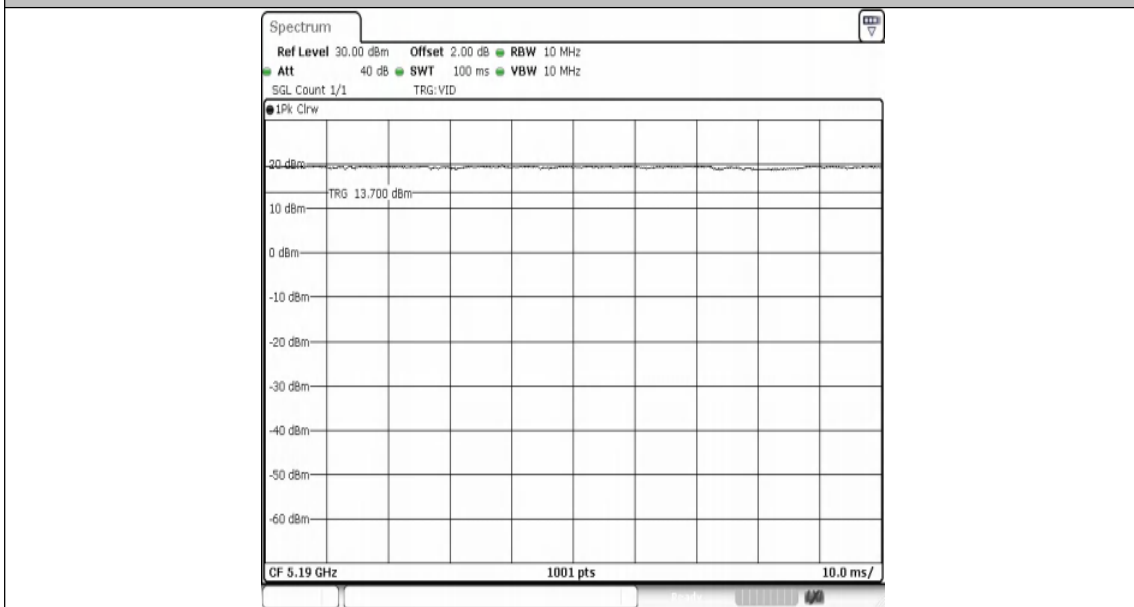


NTNV-11AC40SISO-Ant1-5190


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

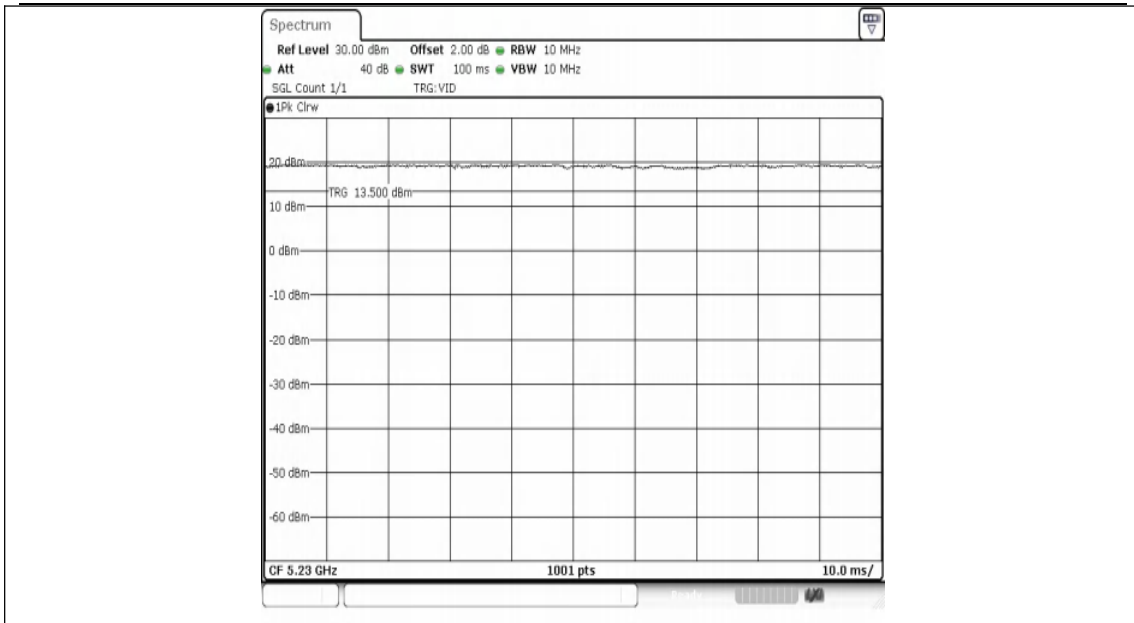

NTNV-11AC40SISO-Ant1-5230

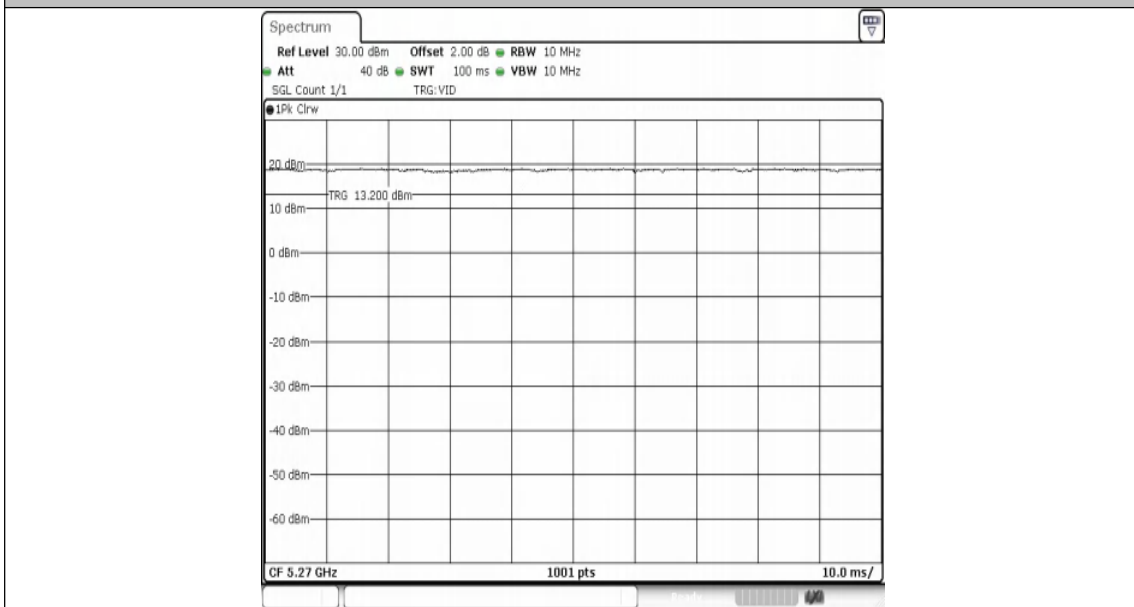


NTNV-11AC40SISO-Ant1-5270


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

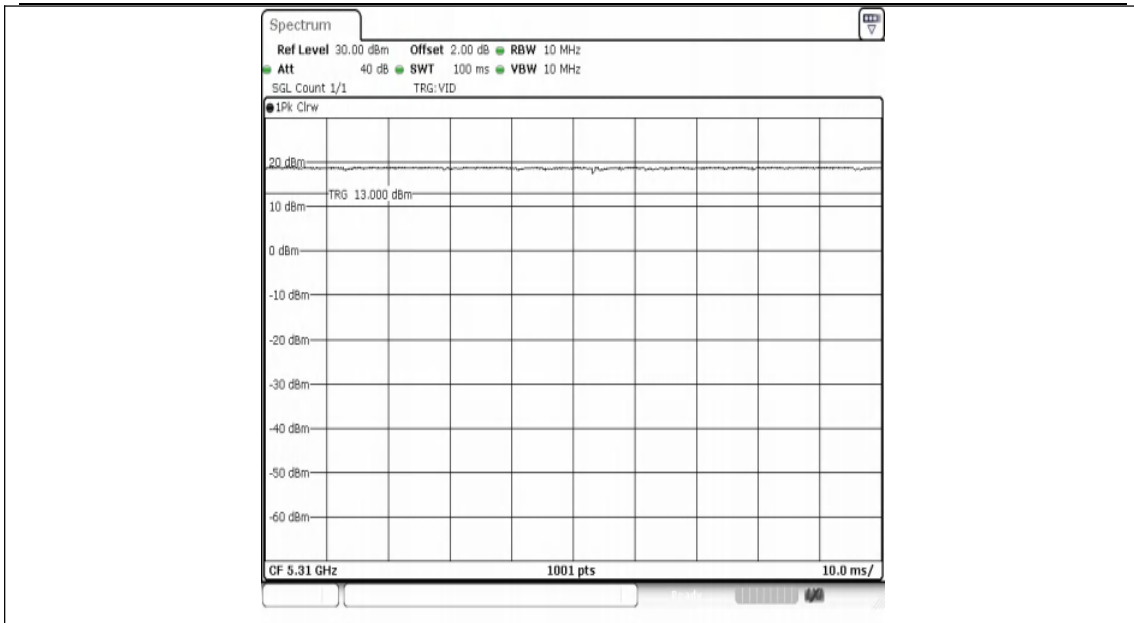

NTNV-11AC40SISO-Ant1-5310

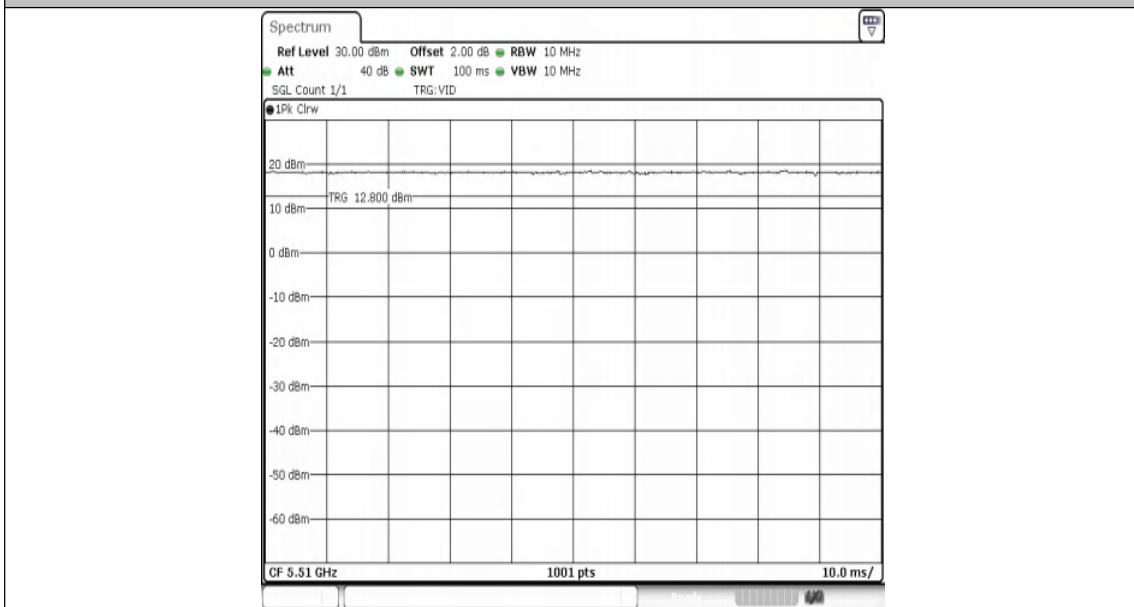


NTNV-11AC40SISO-Ant1-5510


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

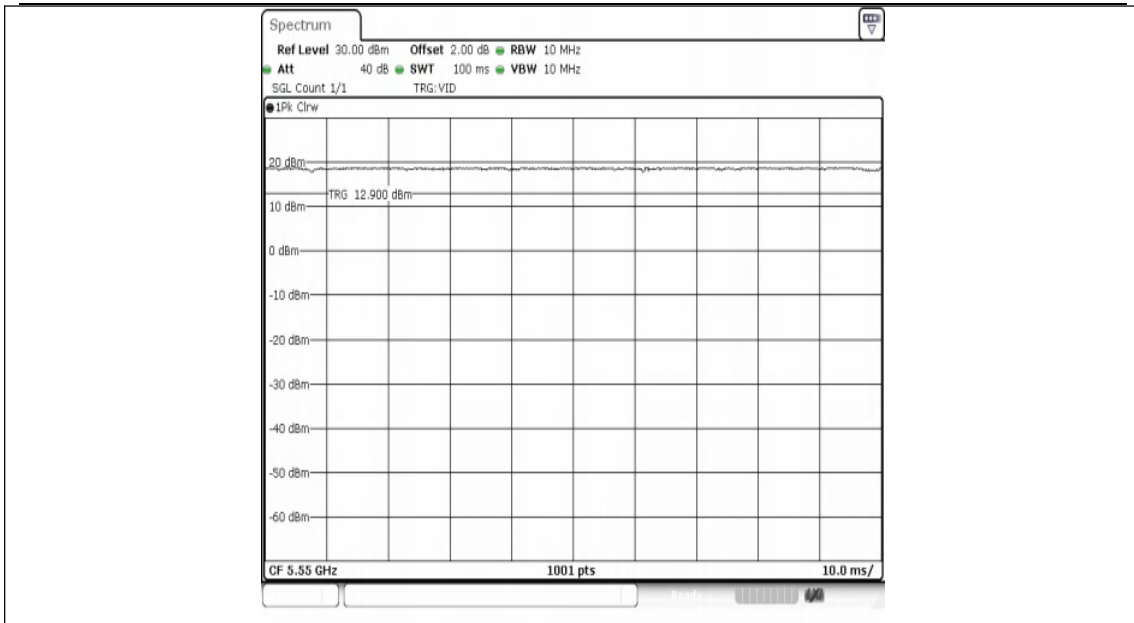


NTNV-11AC40SISO-Ant1-5550

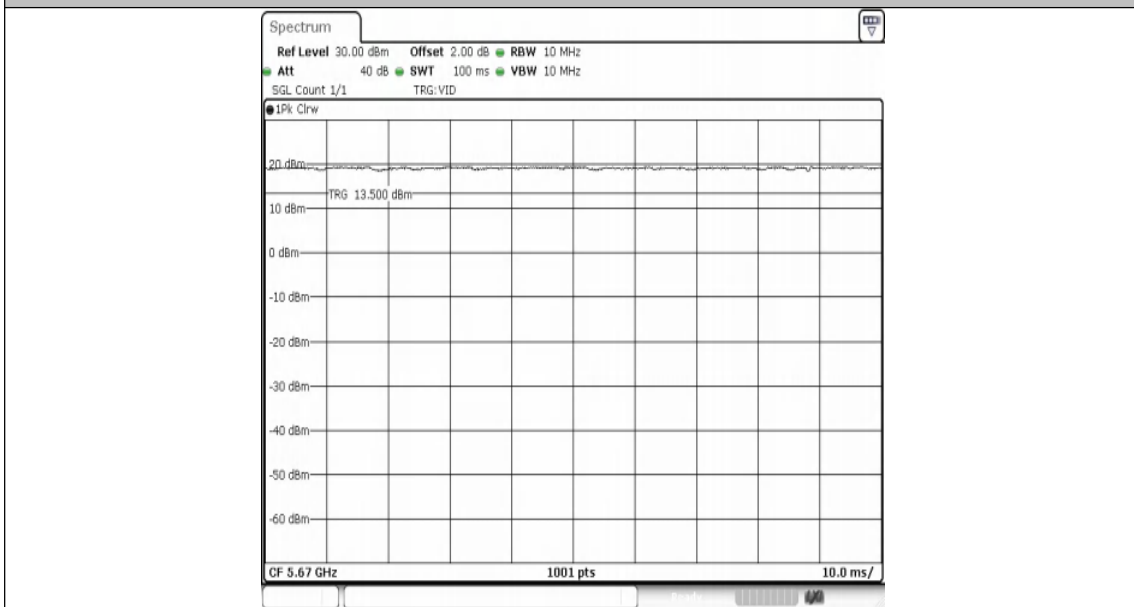

NTNV-11AC40SISO-Ant1-5670

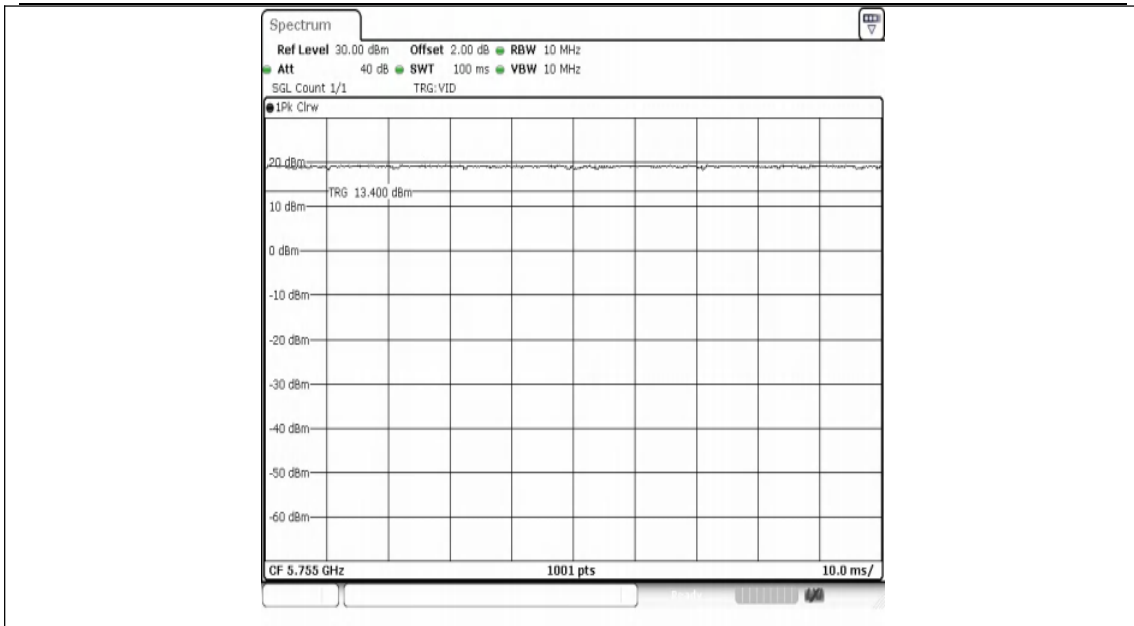

NTNV-11AC40SISO-Ant1-5755

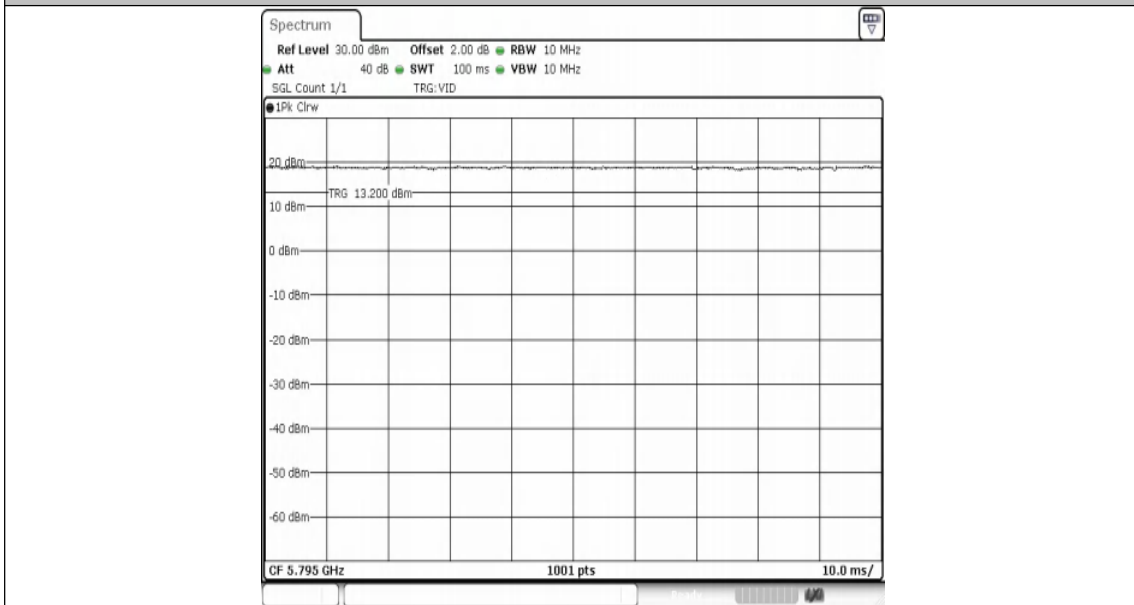


NTNV-11AC40SISO-Ant1-5795

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

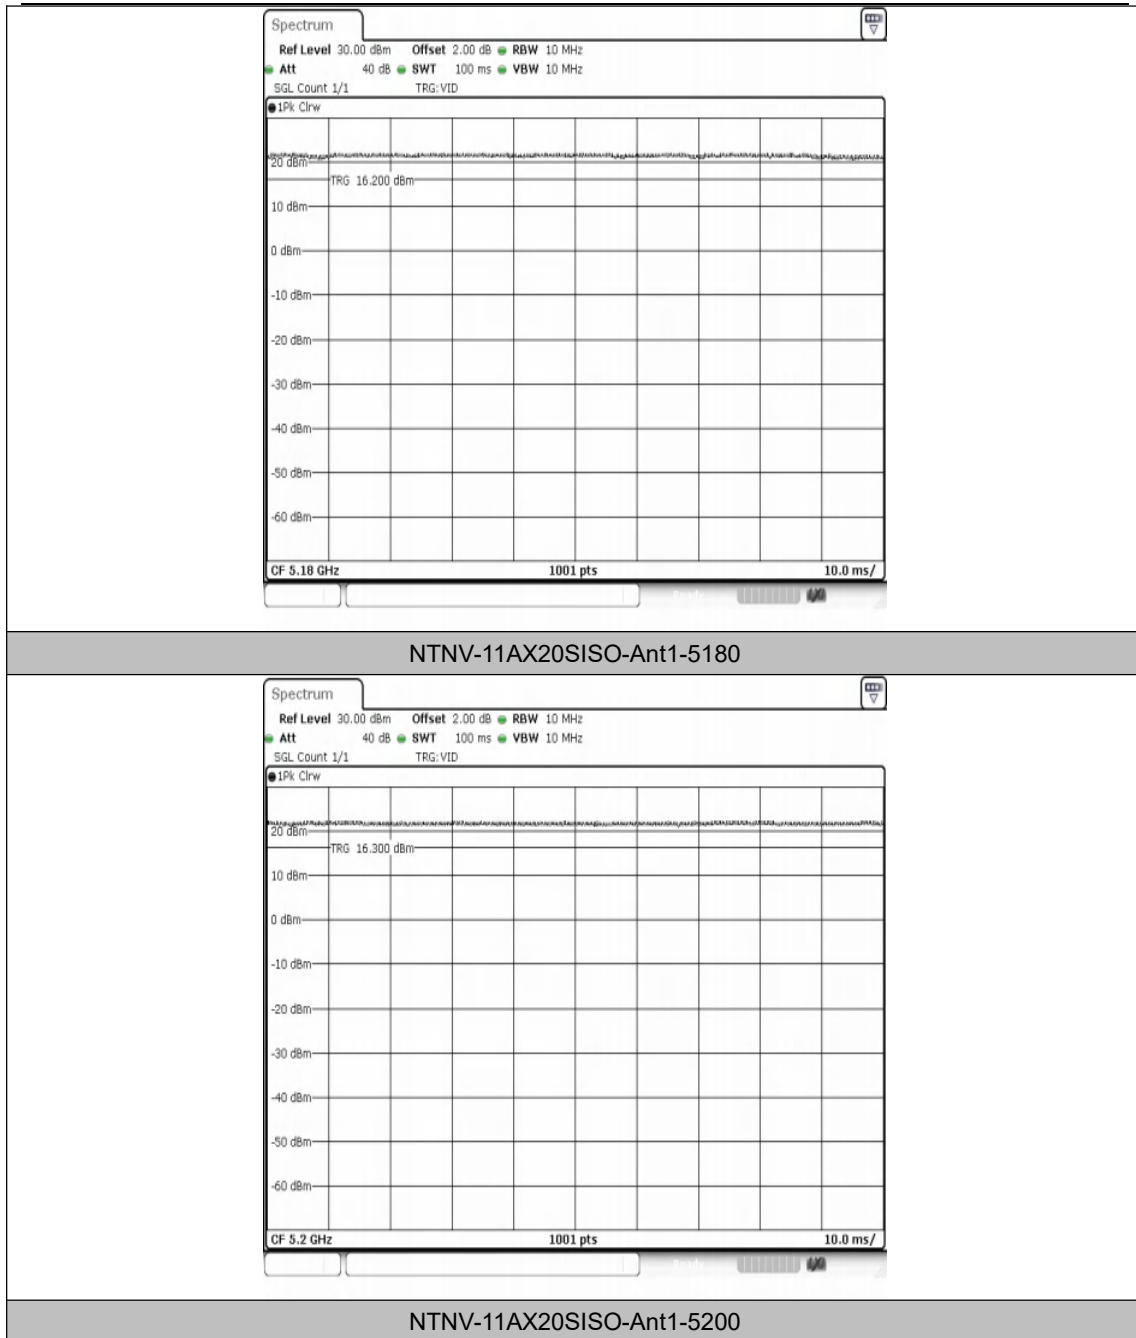

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com