






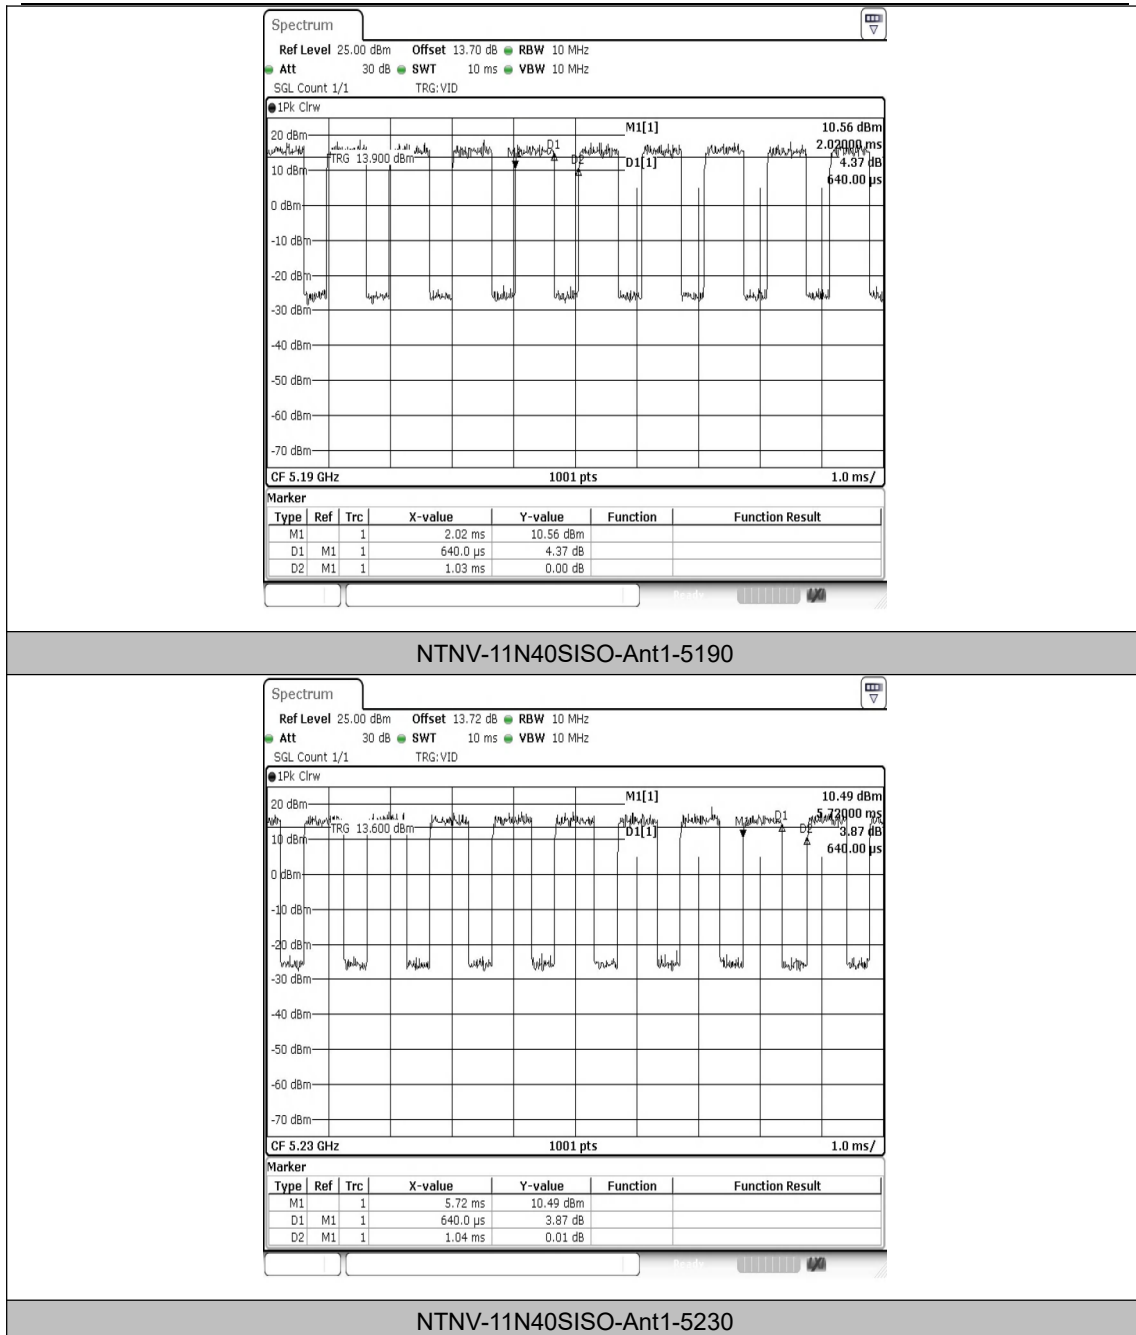


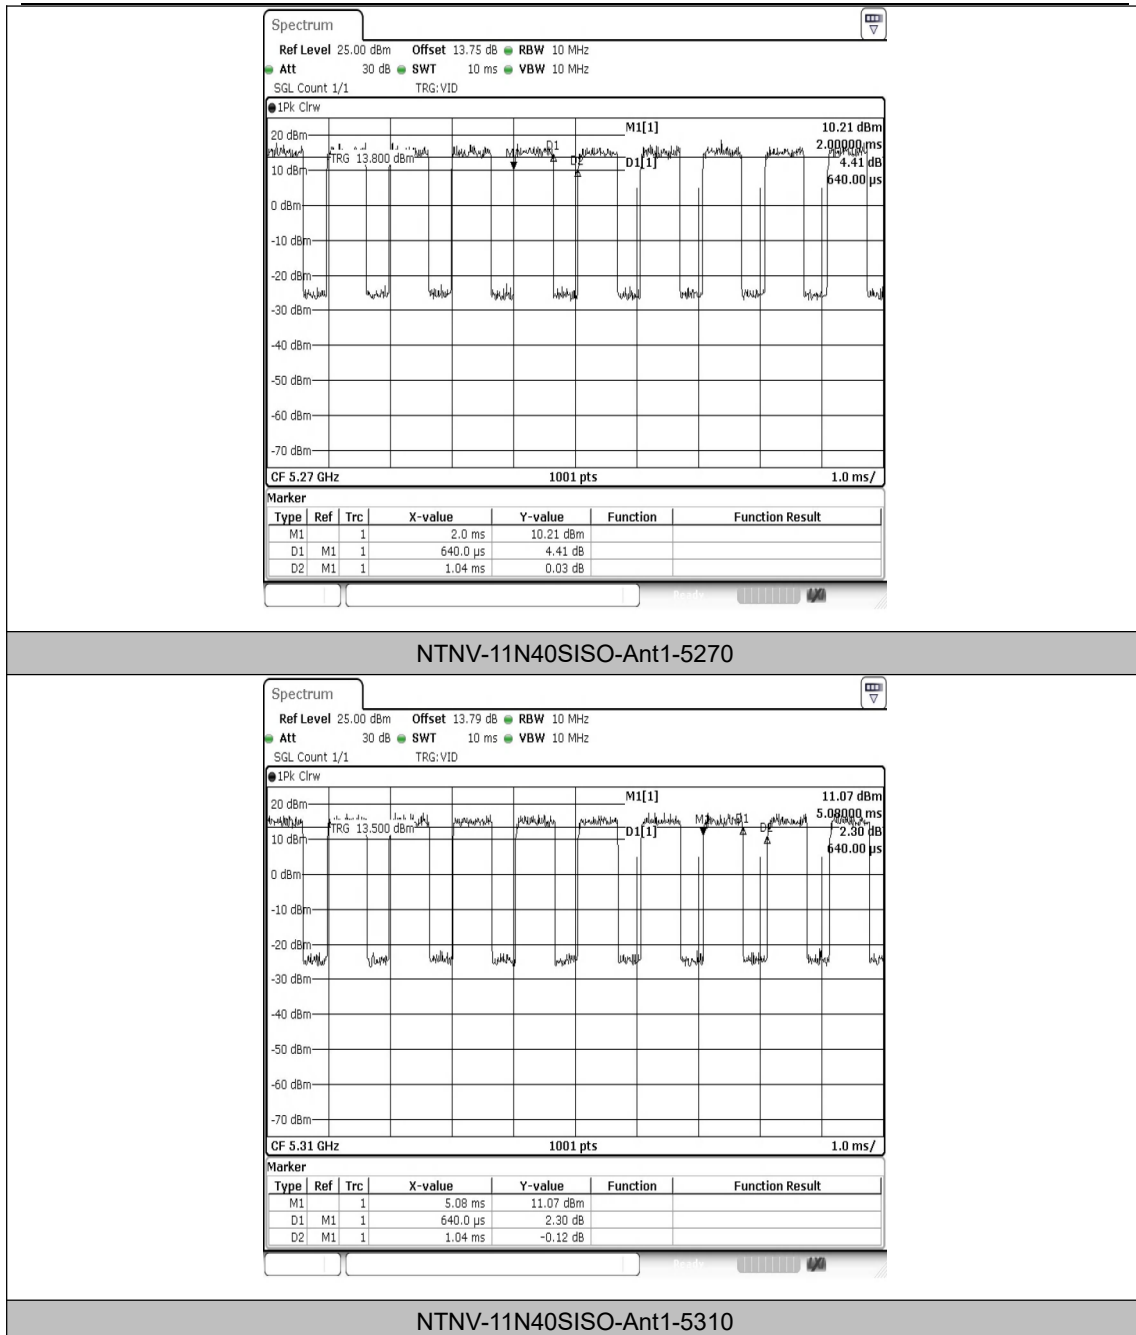


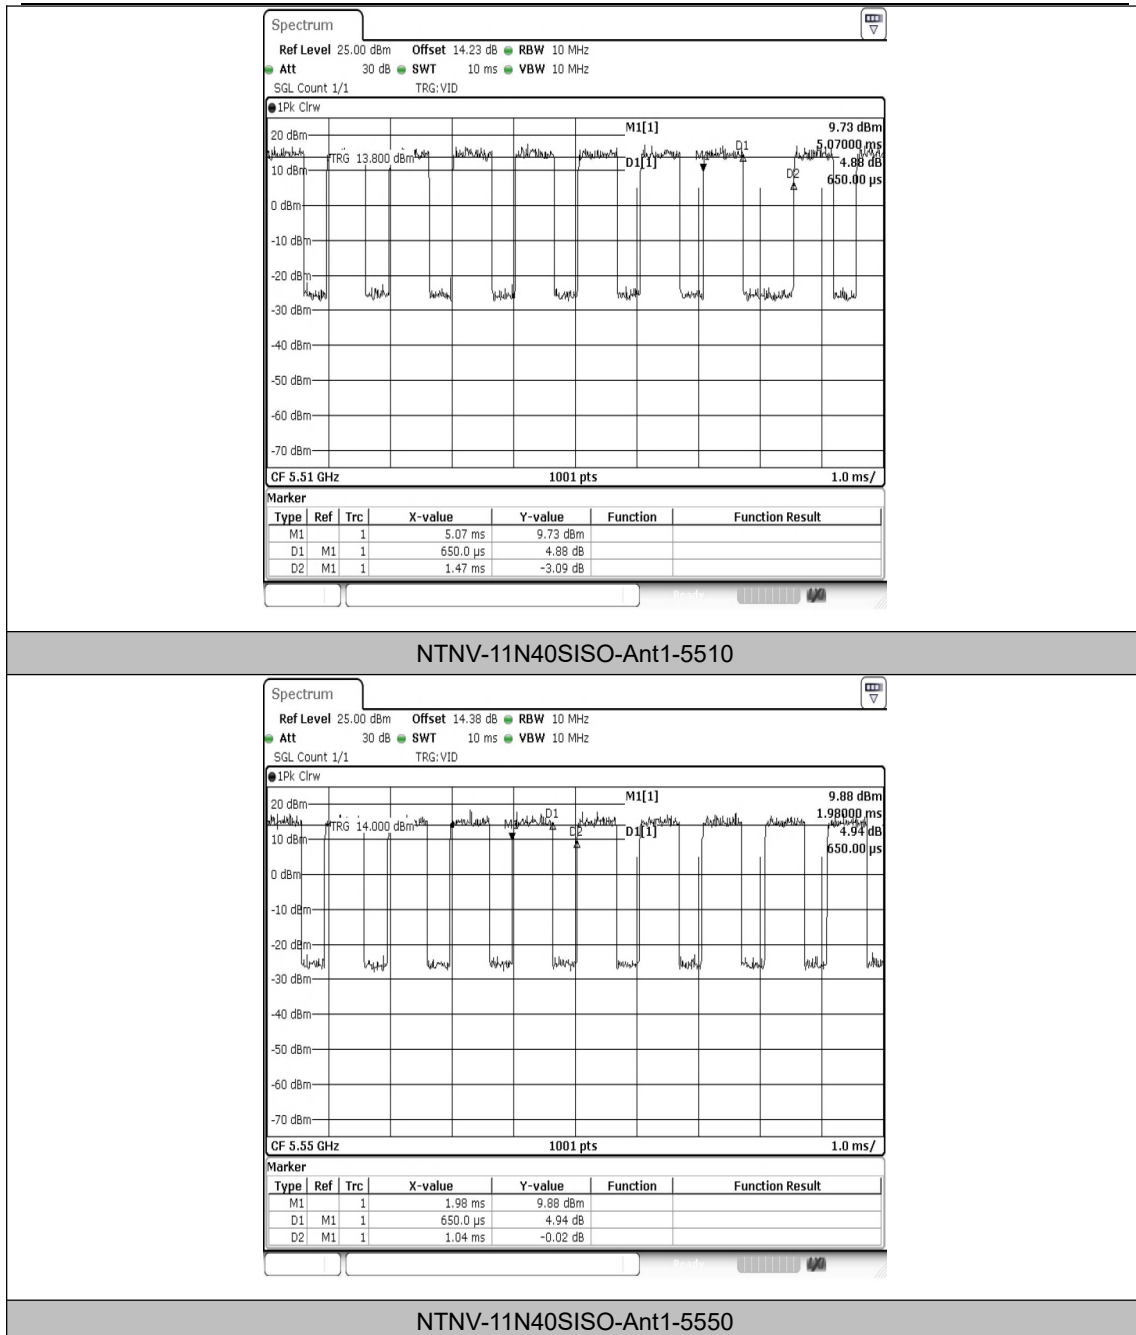


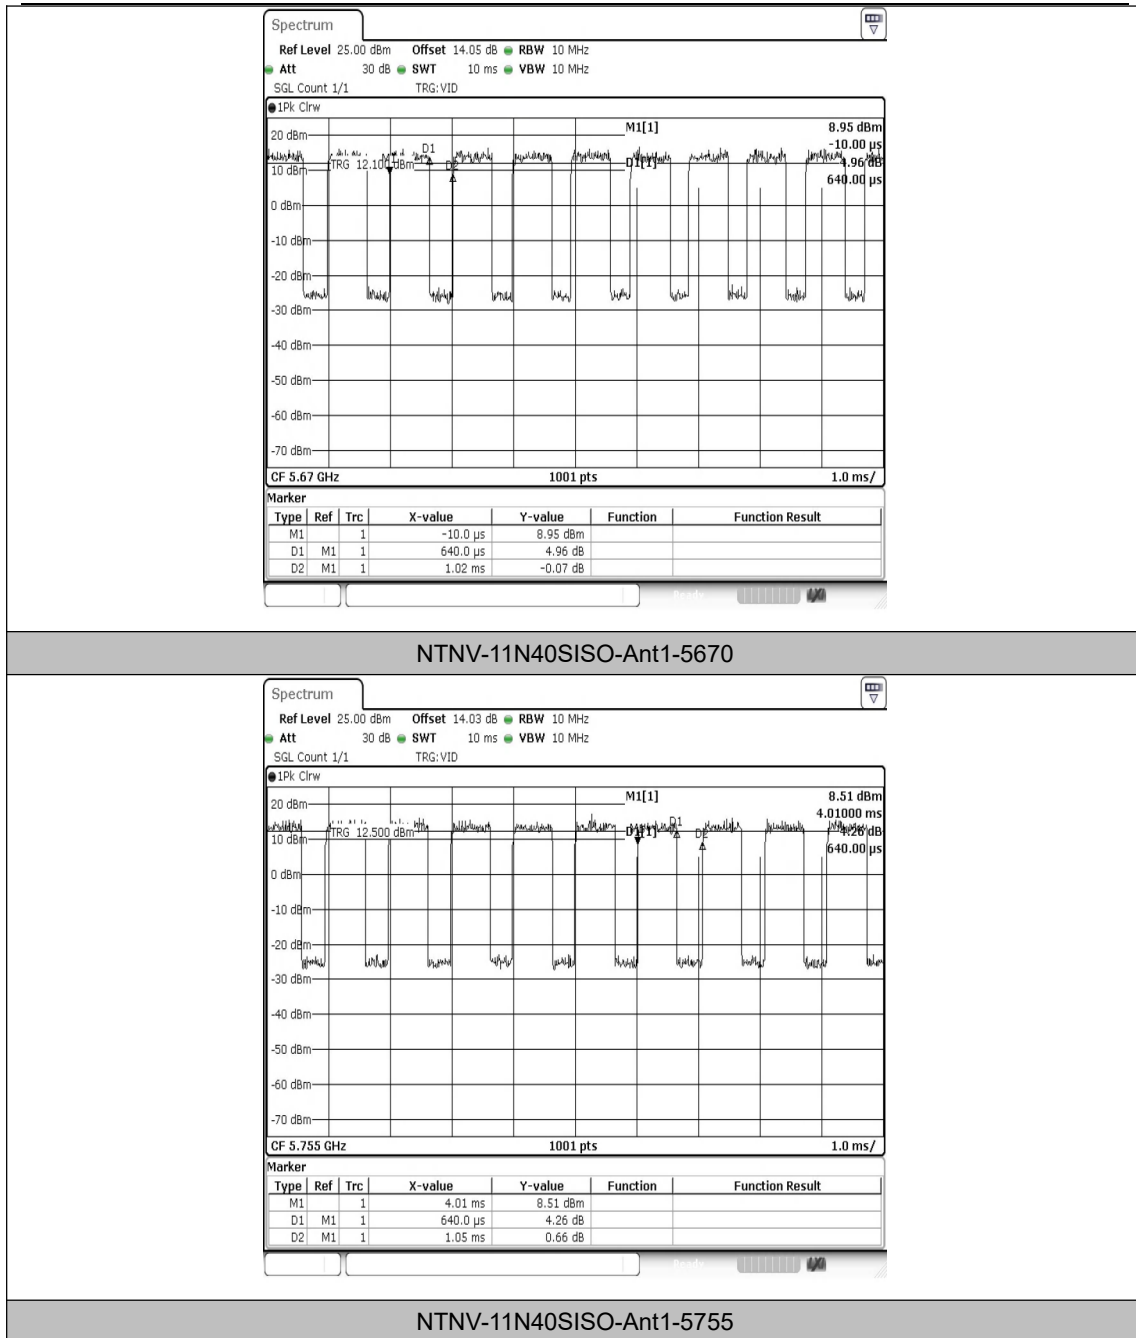


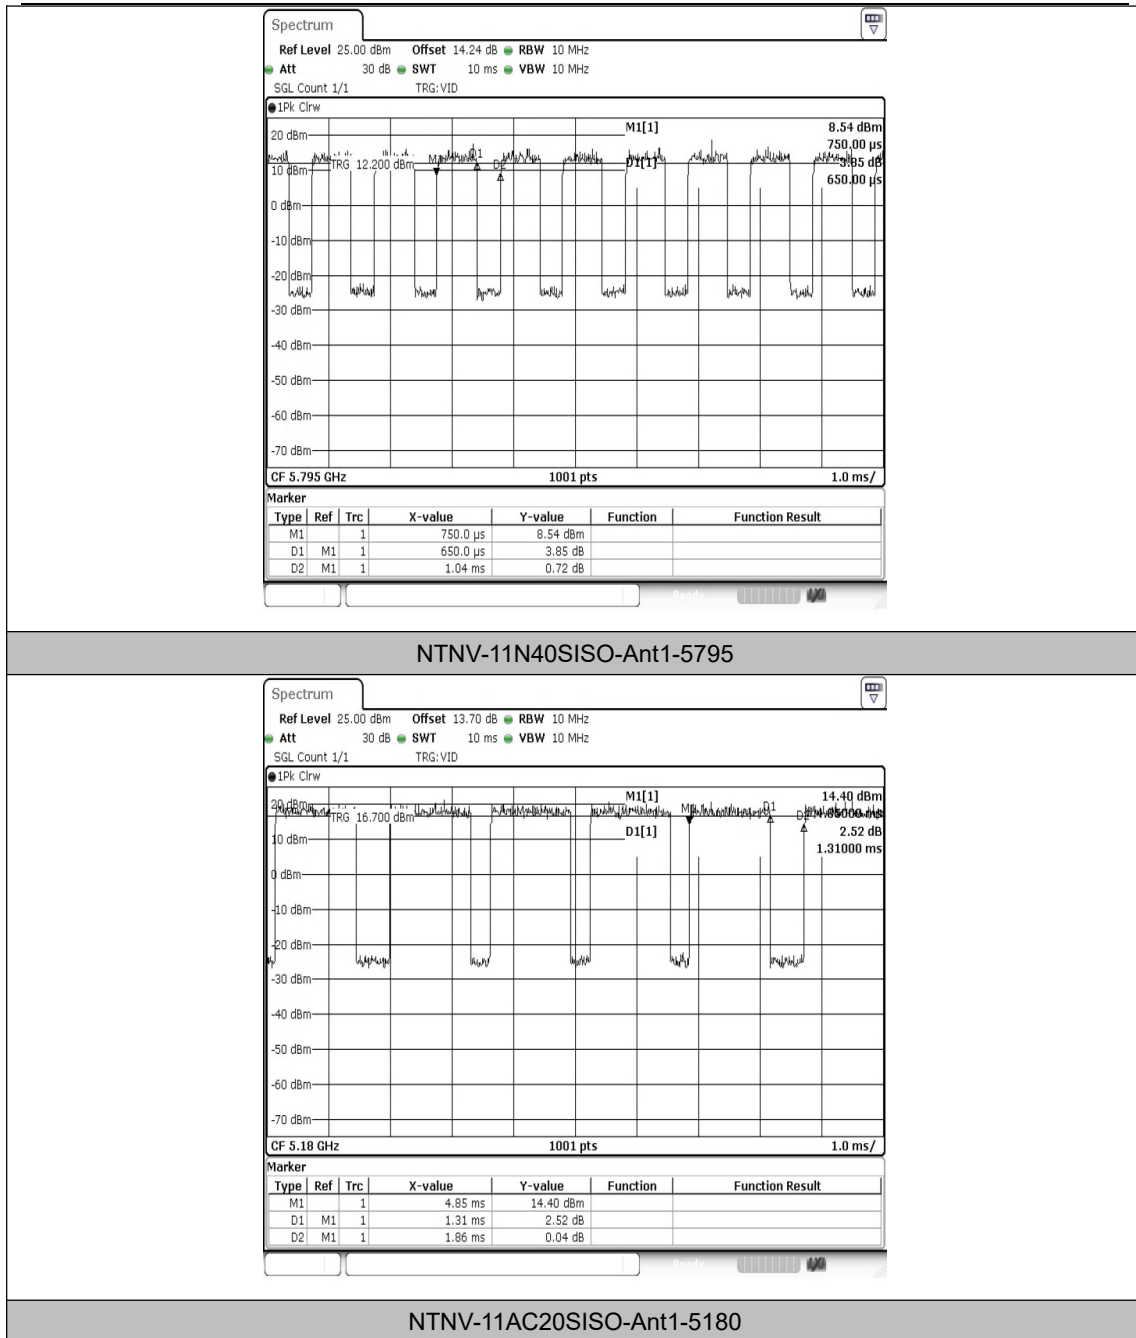


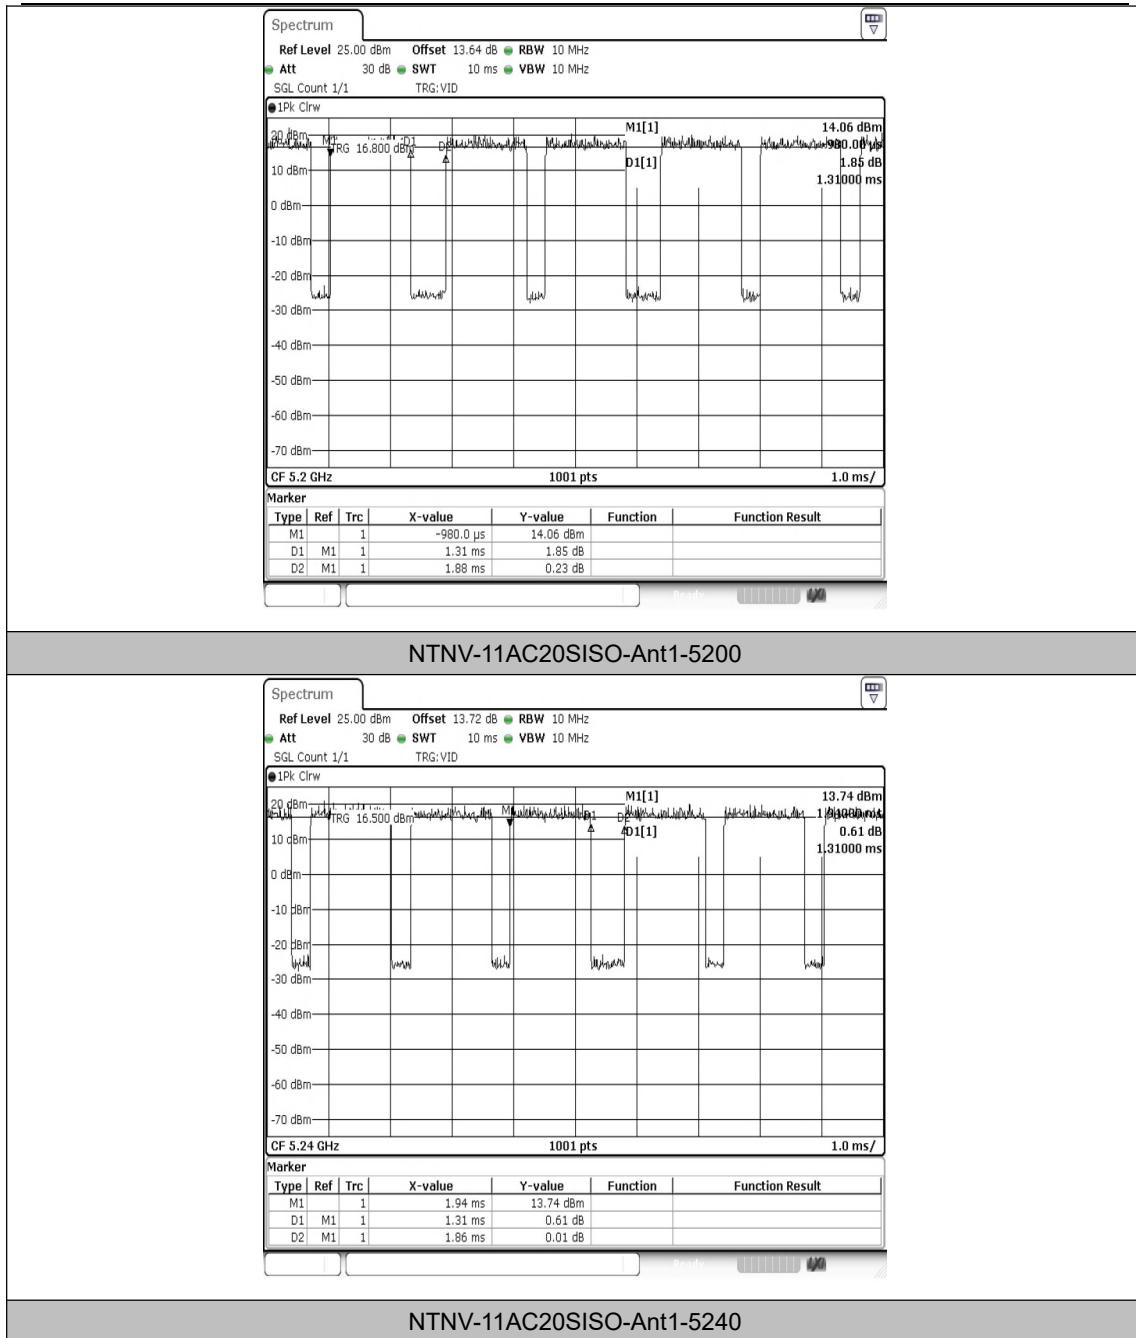


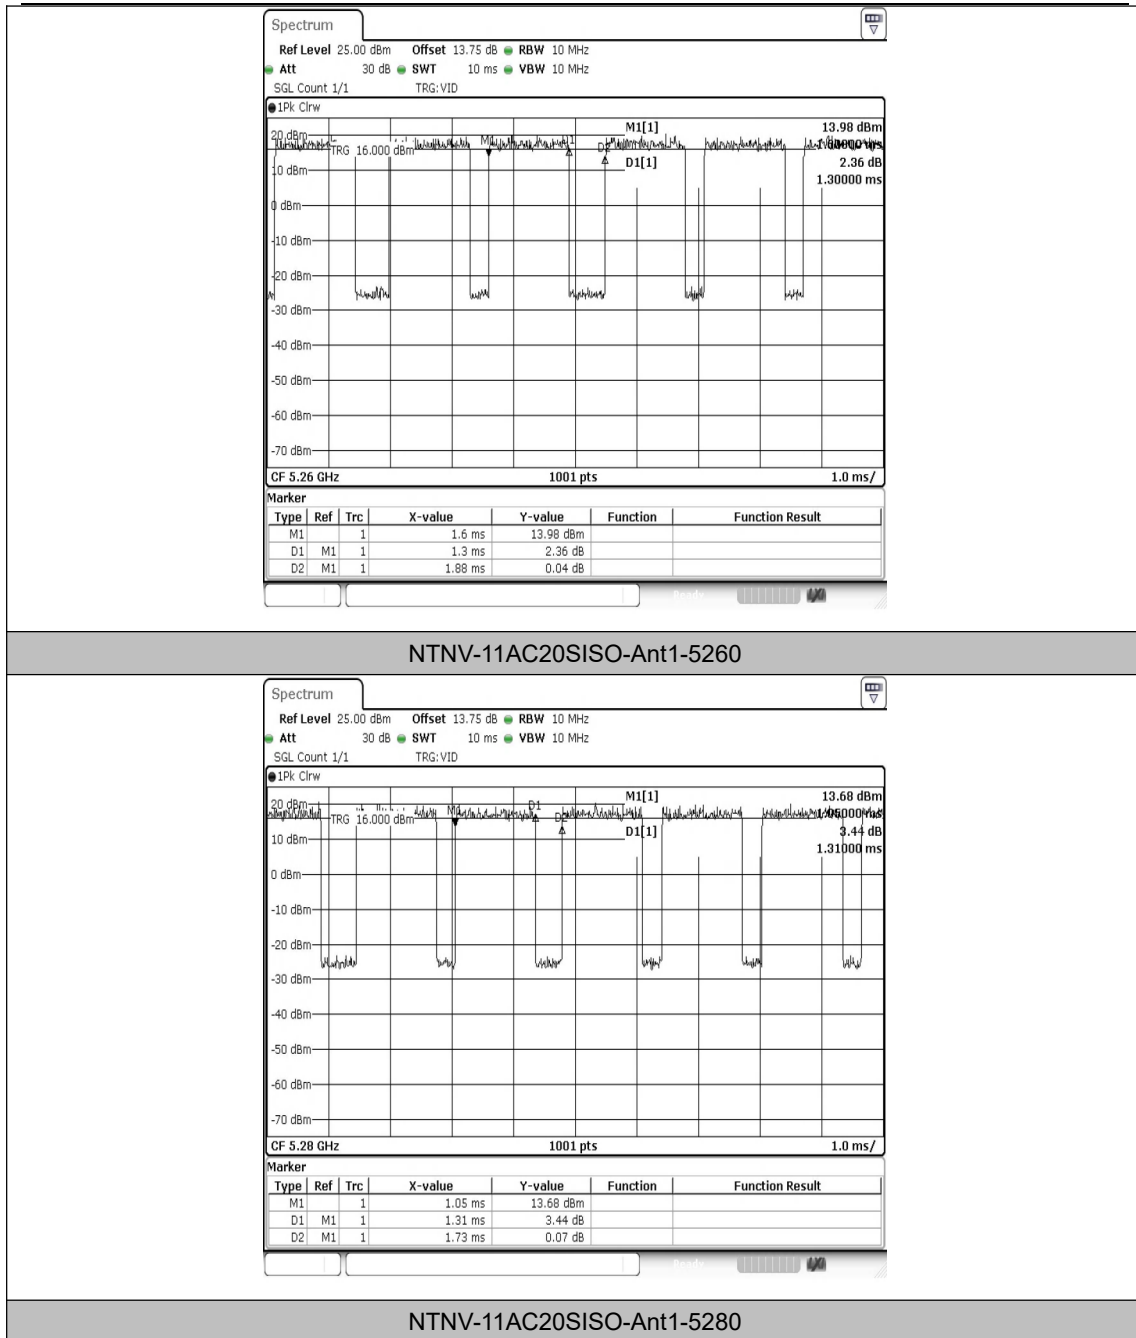


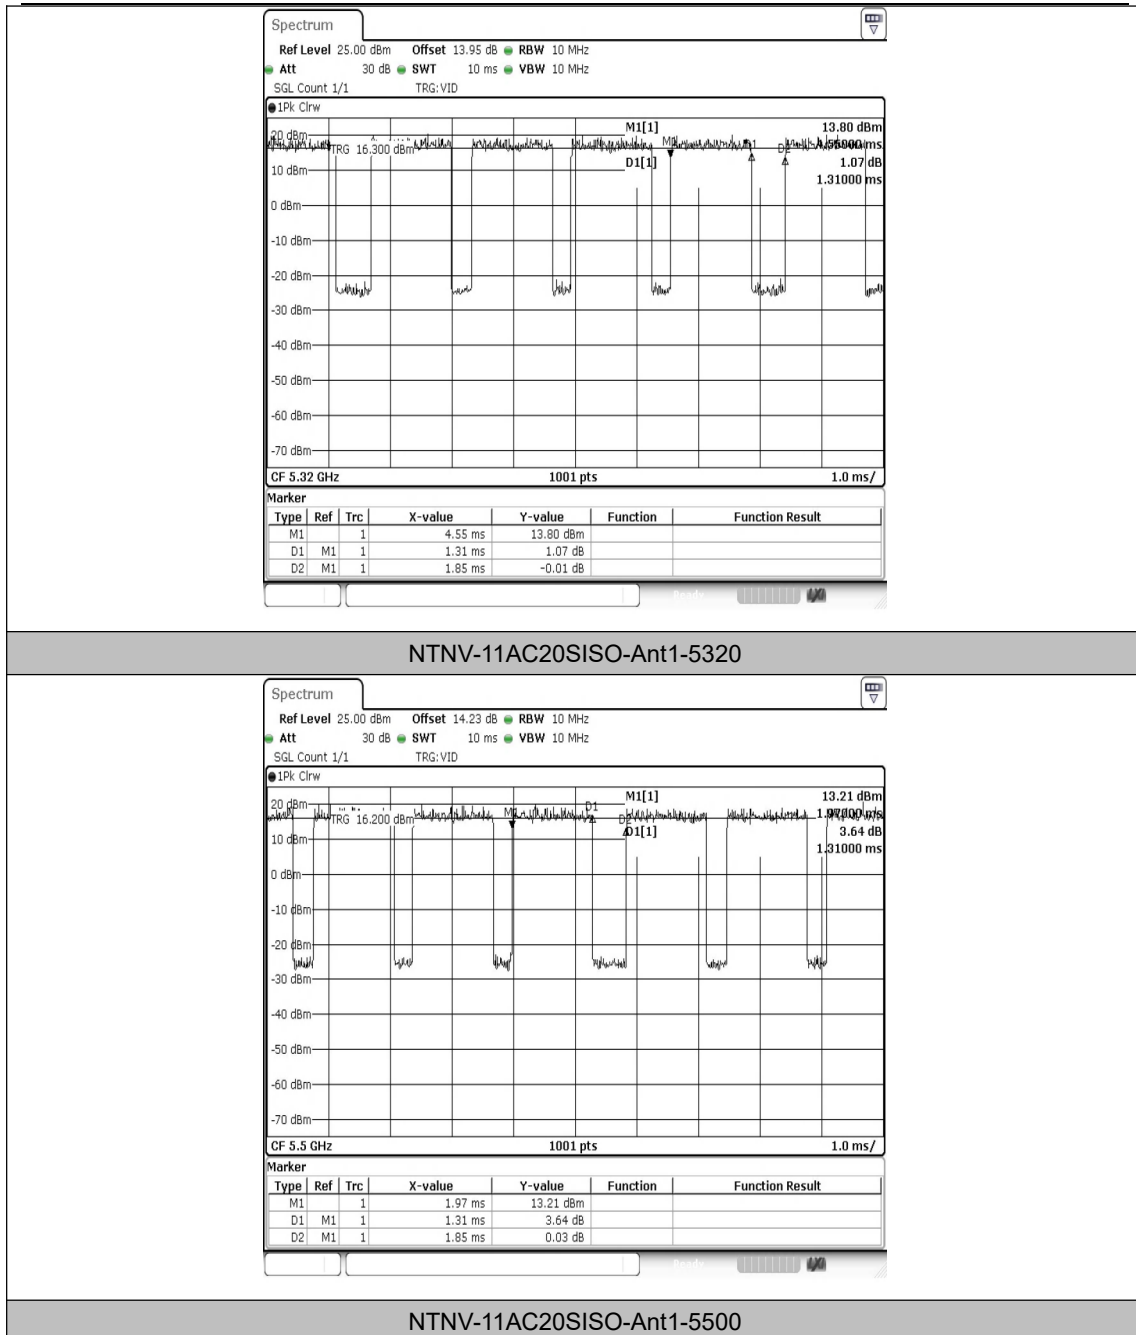


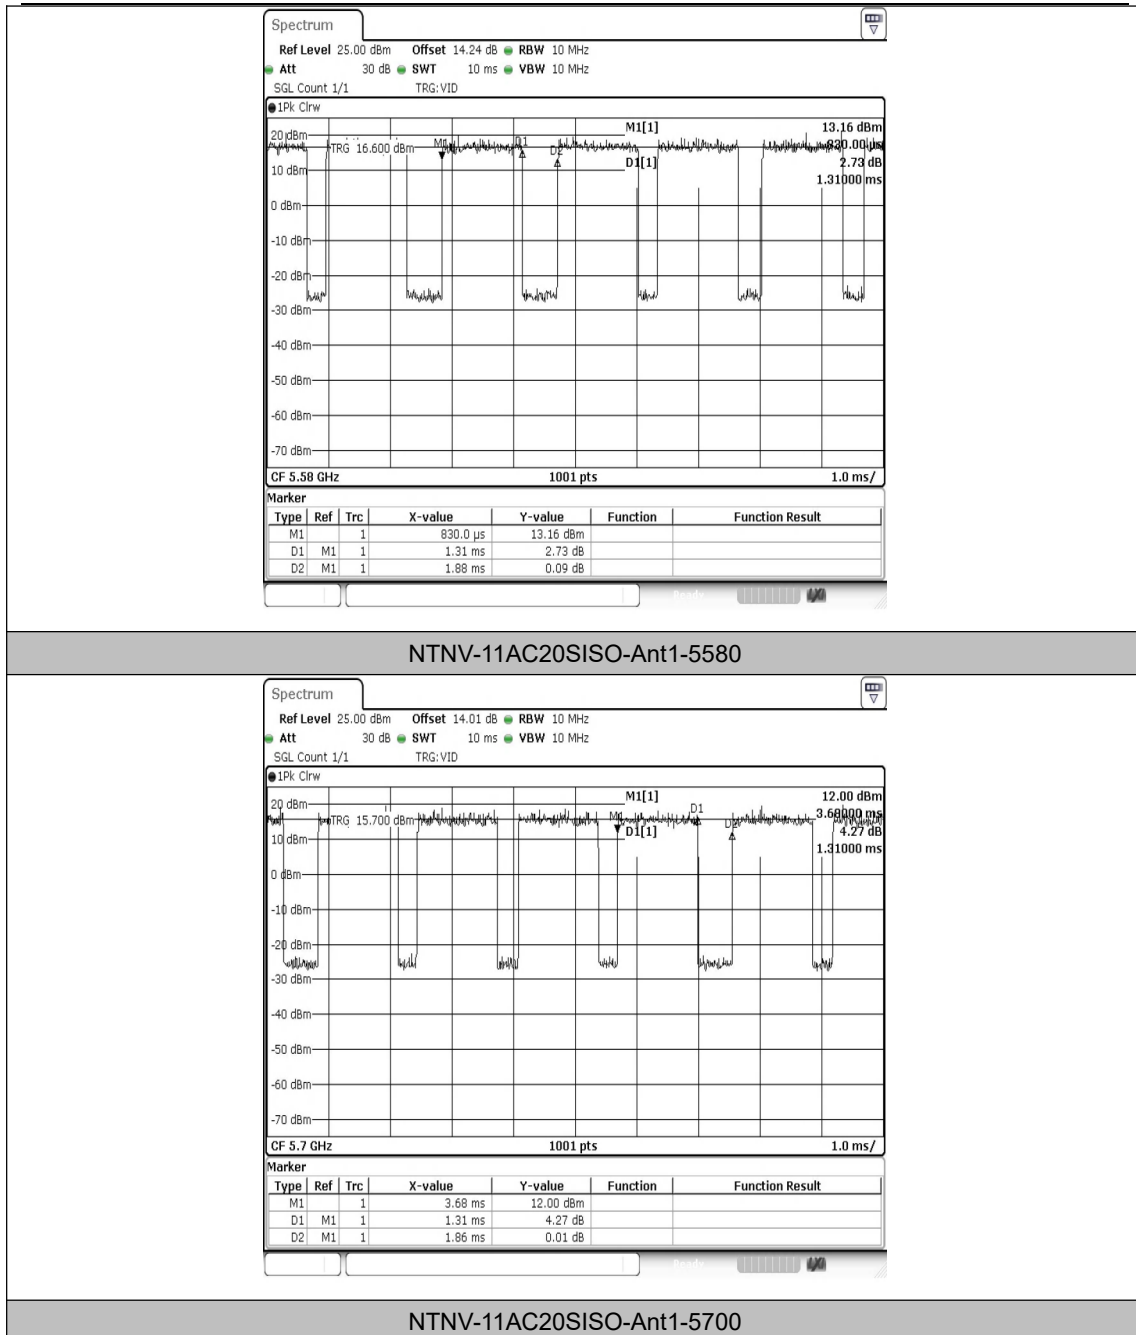


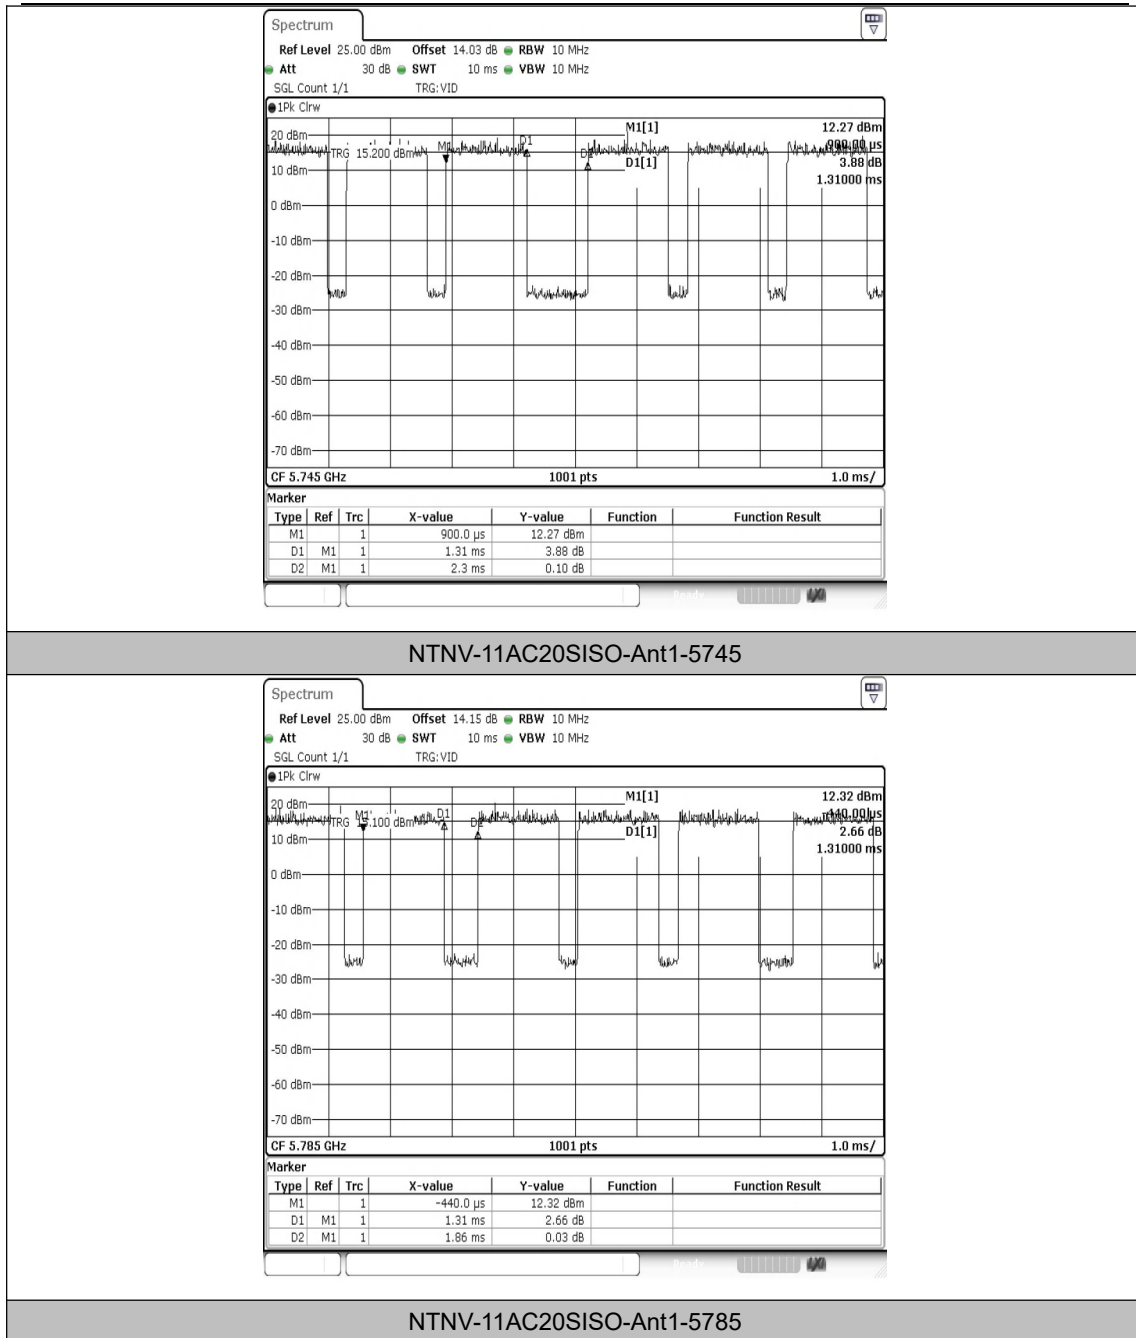


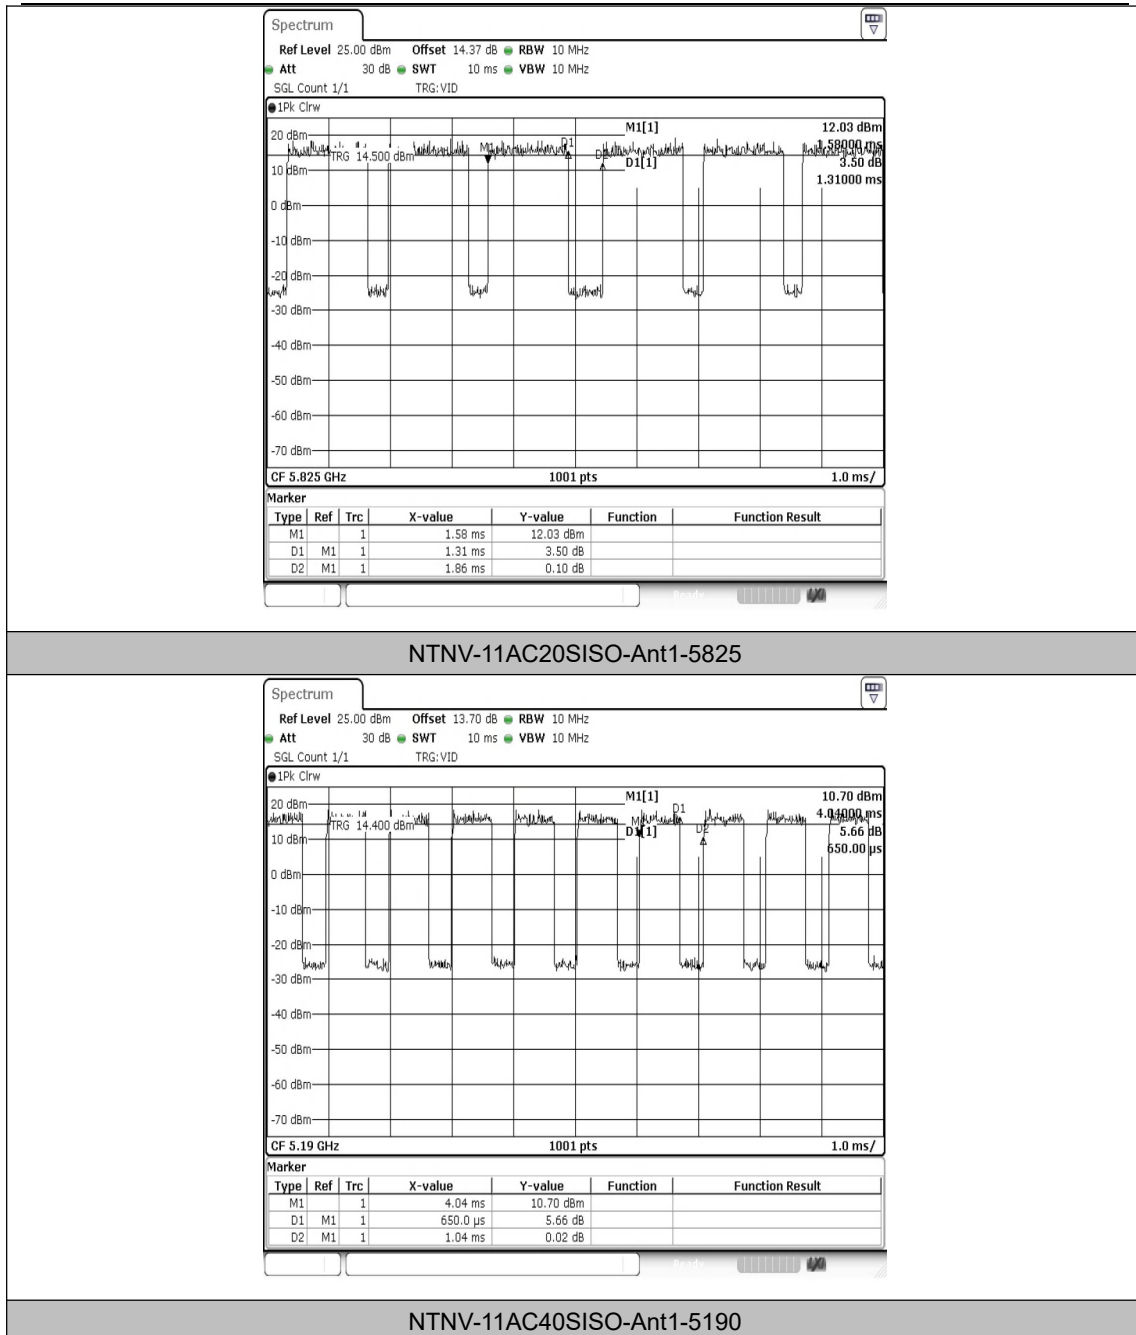


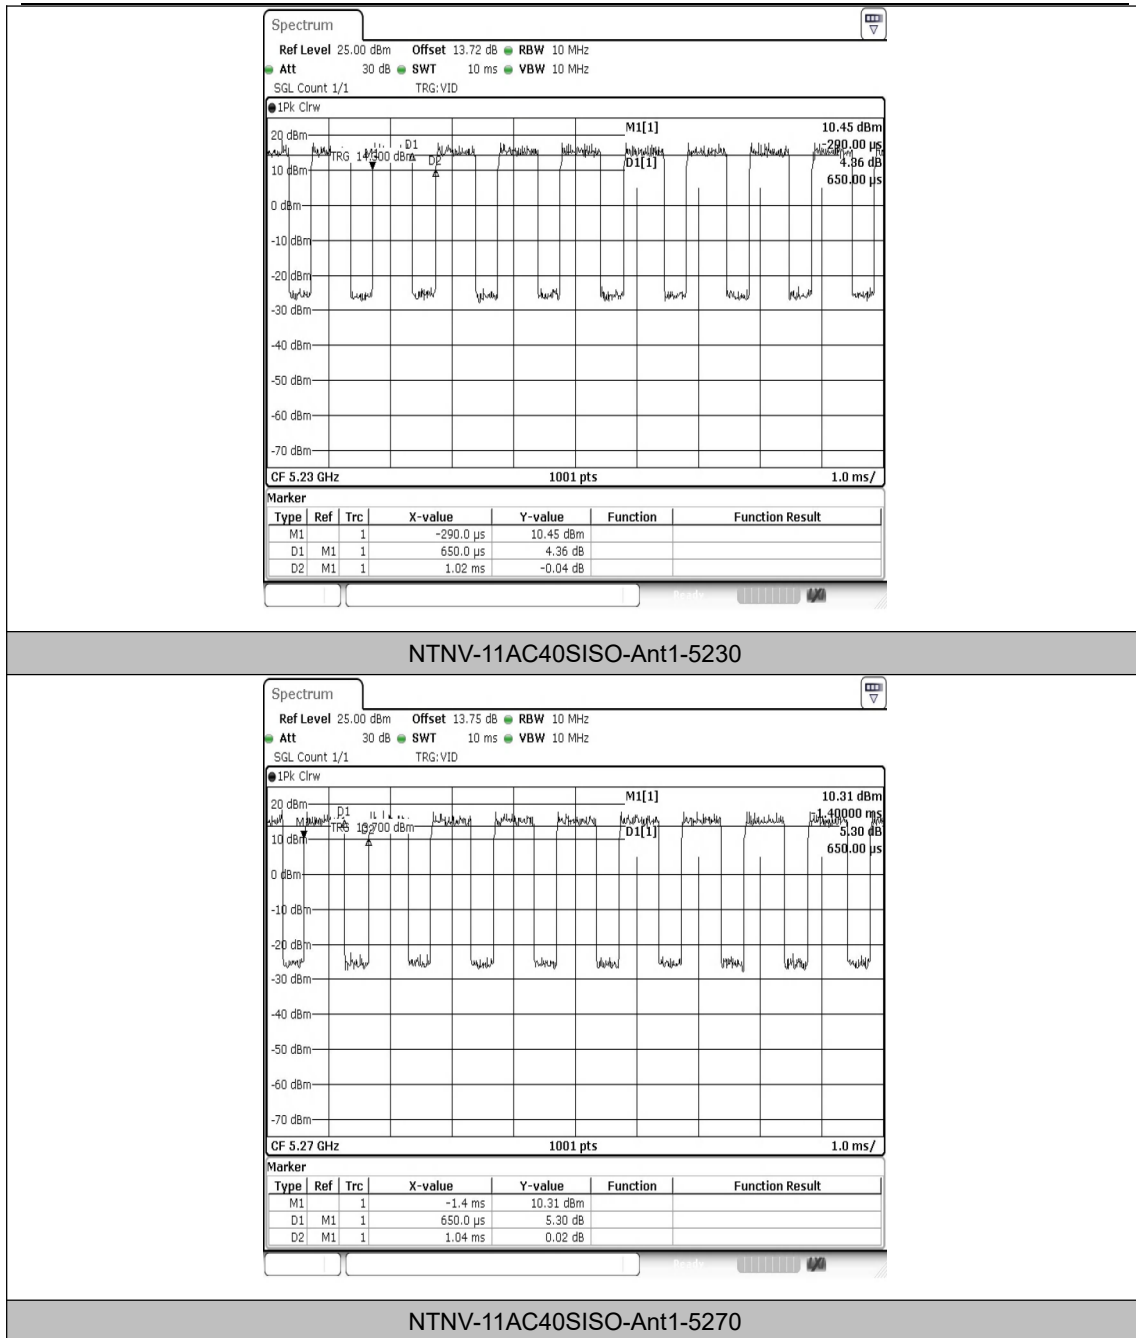


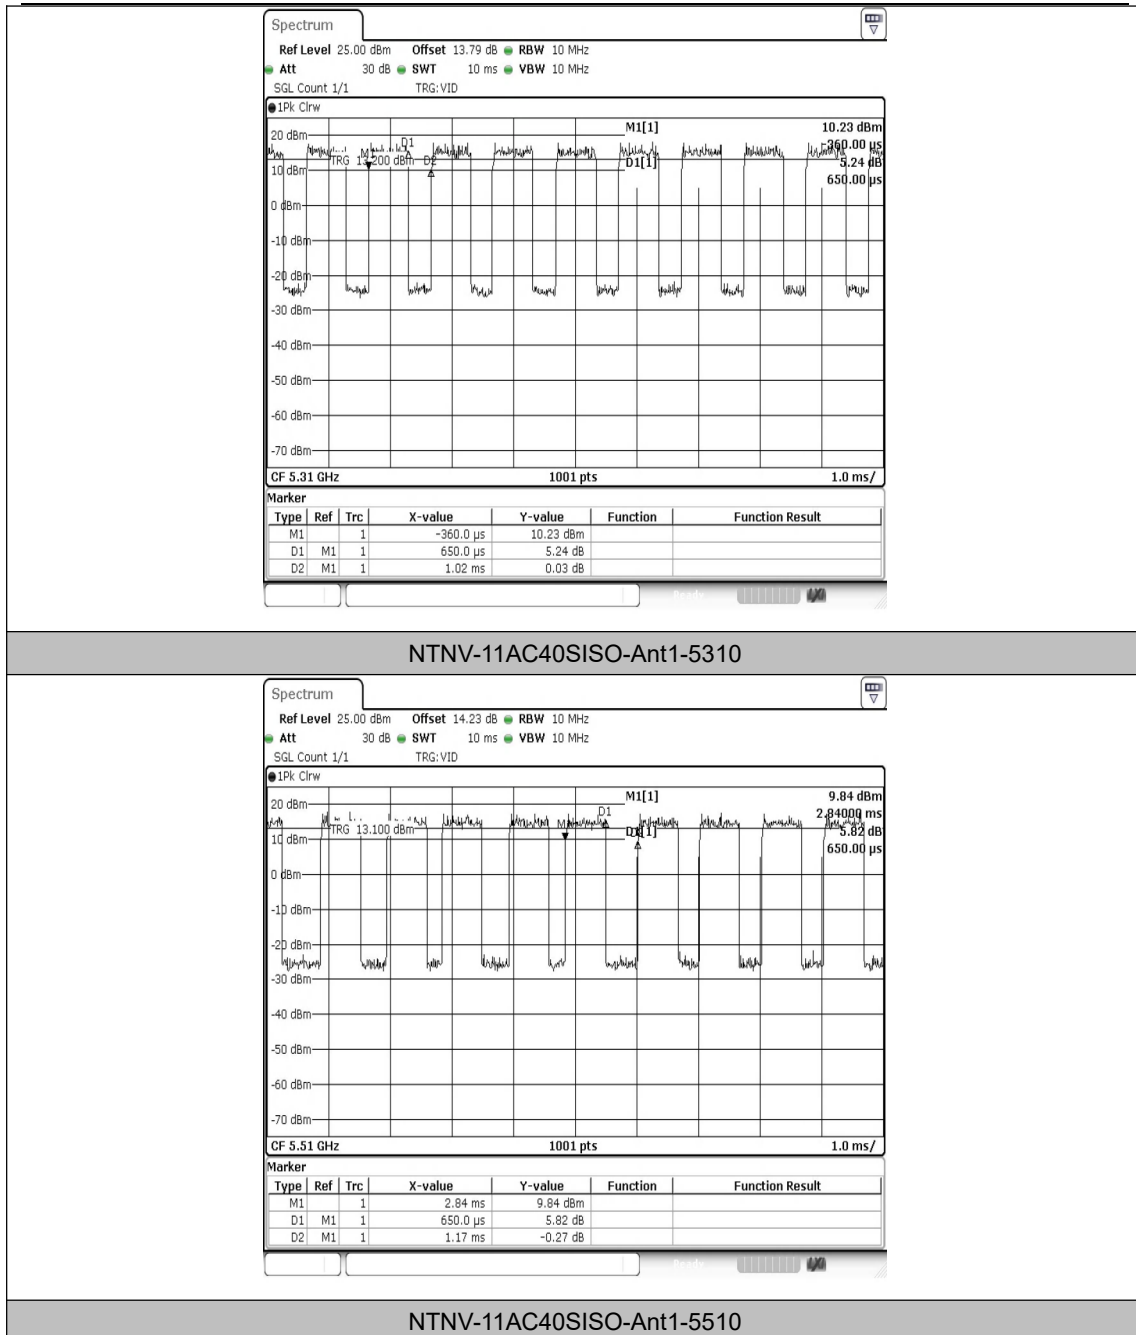


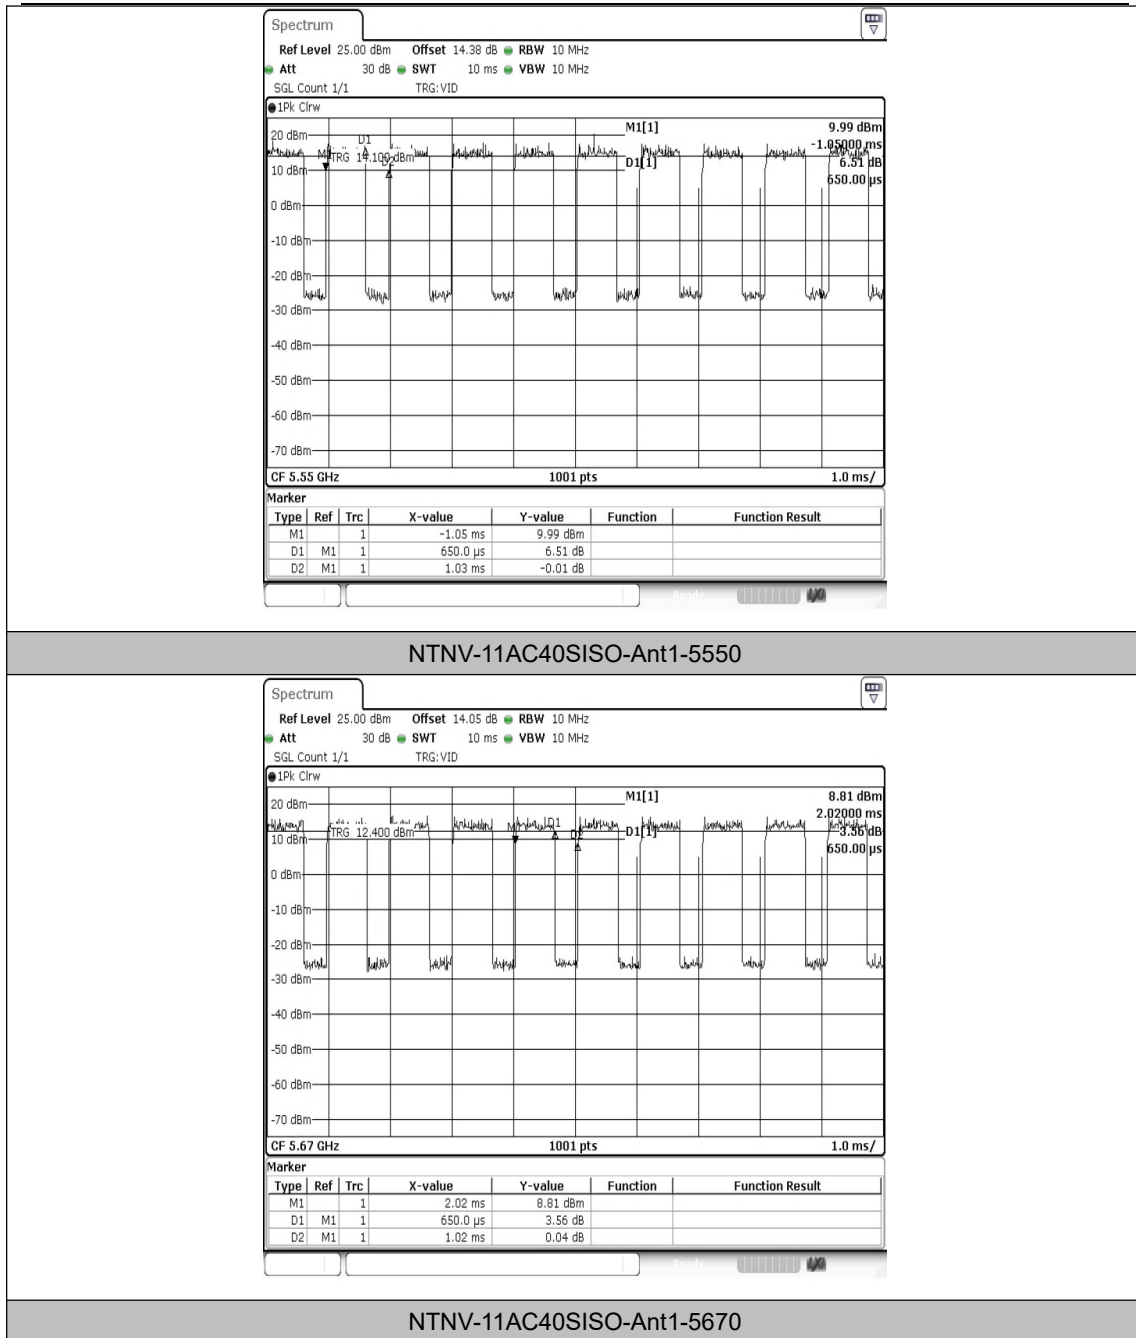


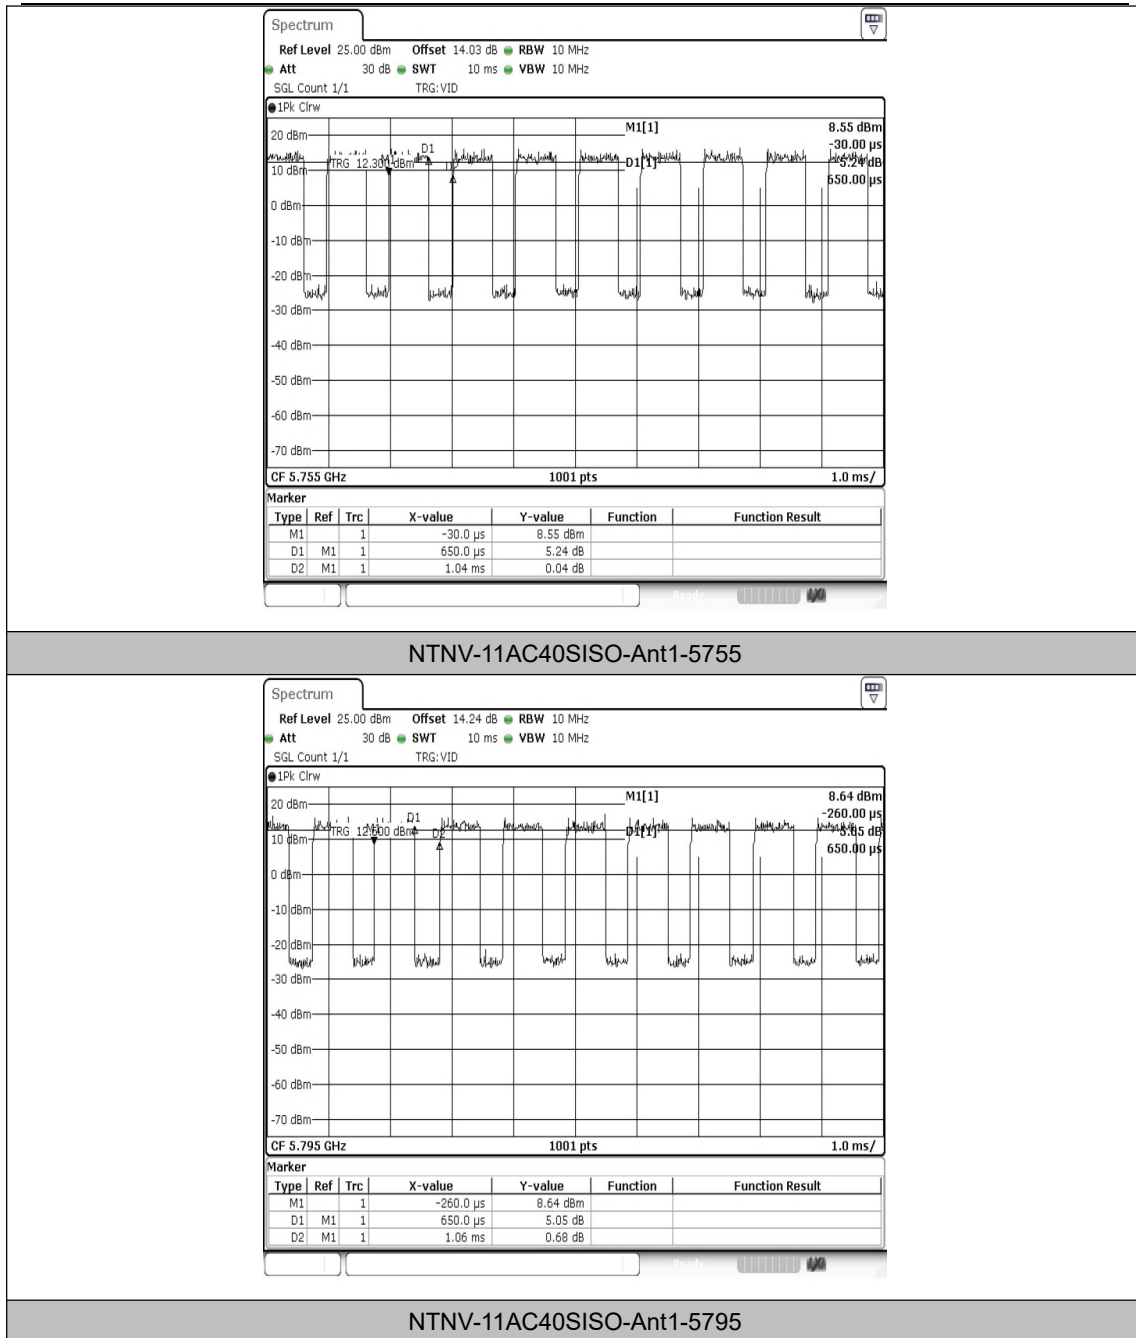


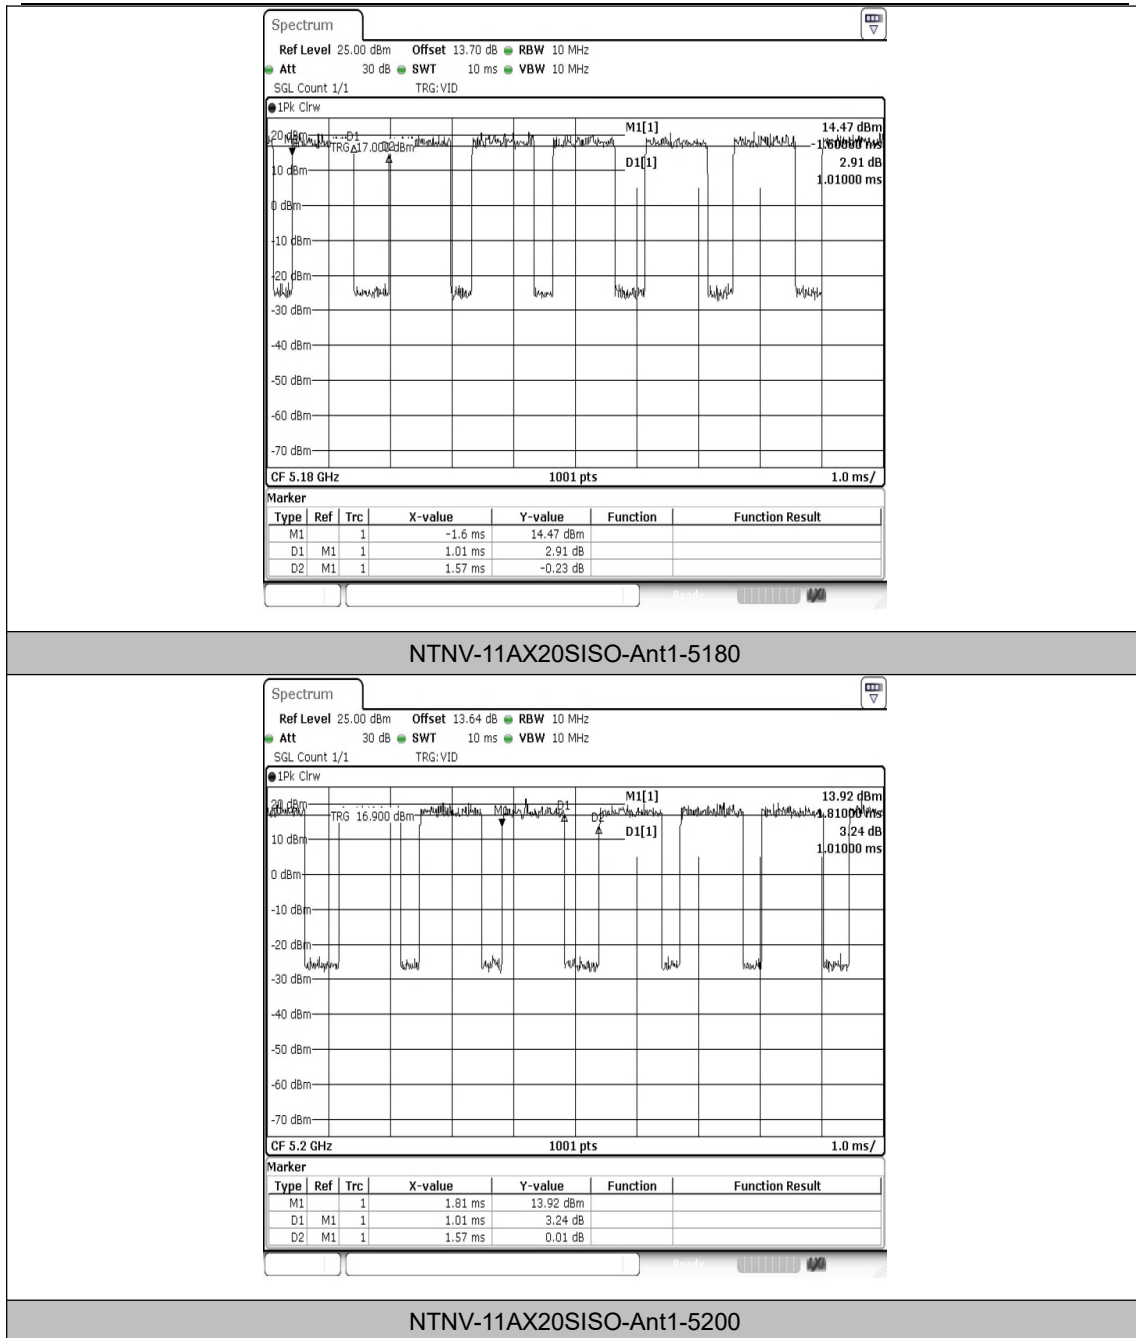


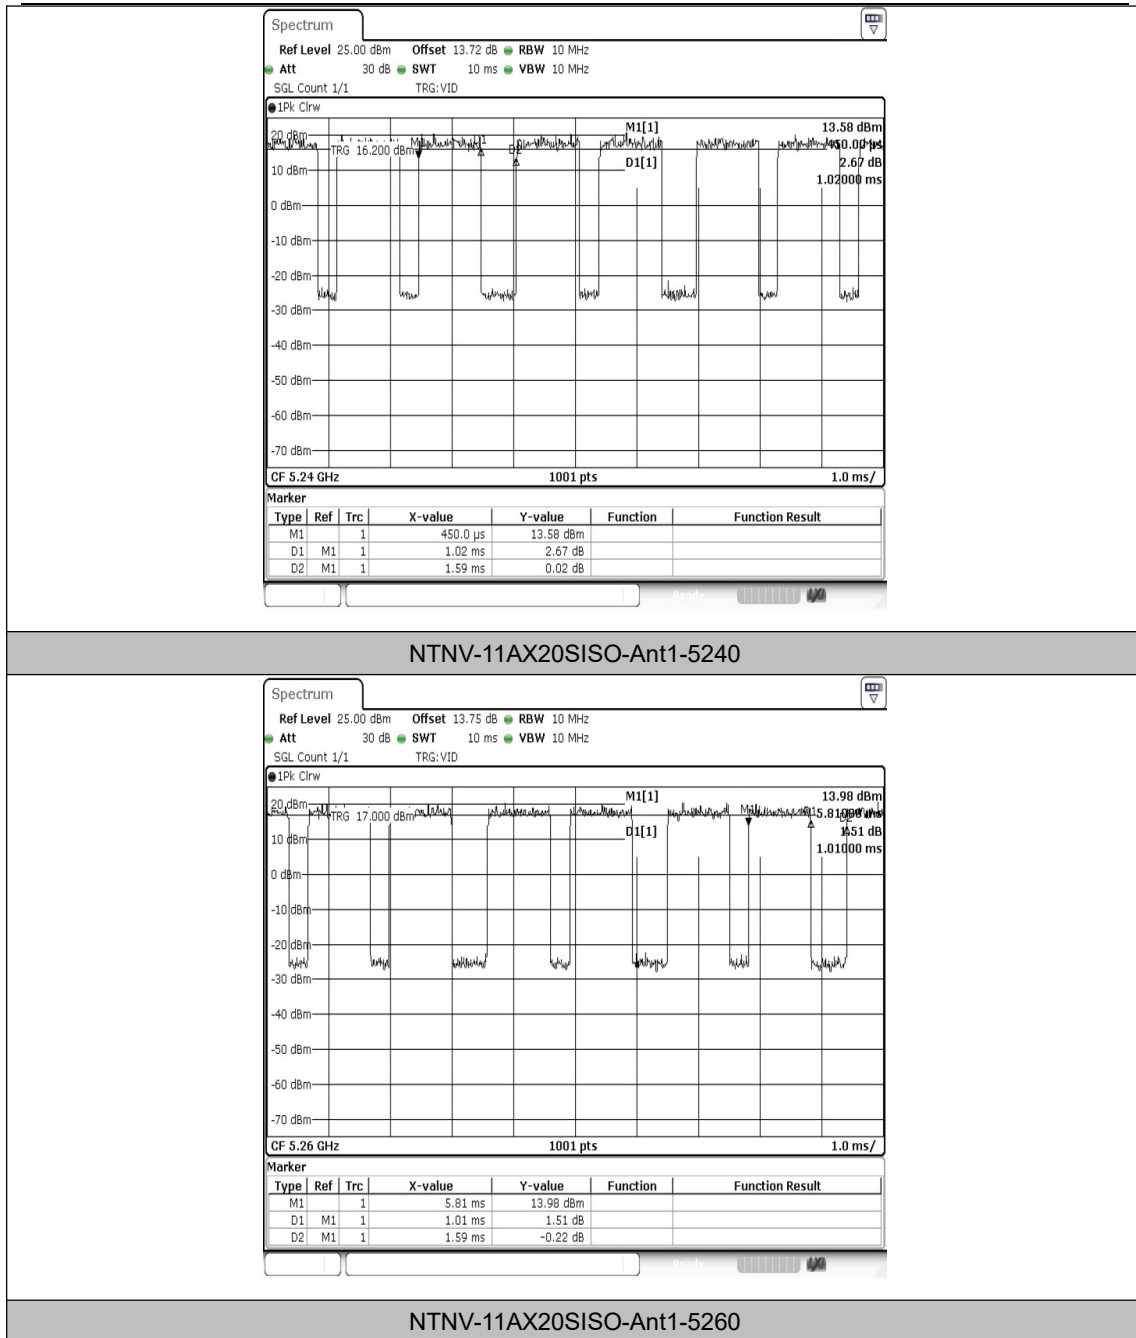


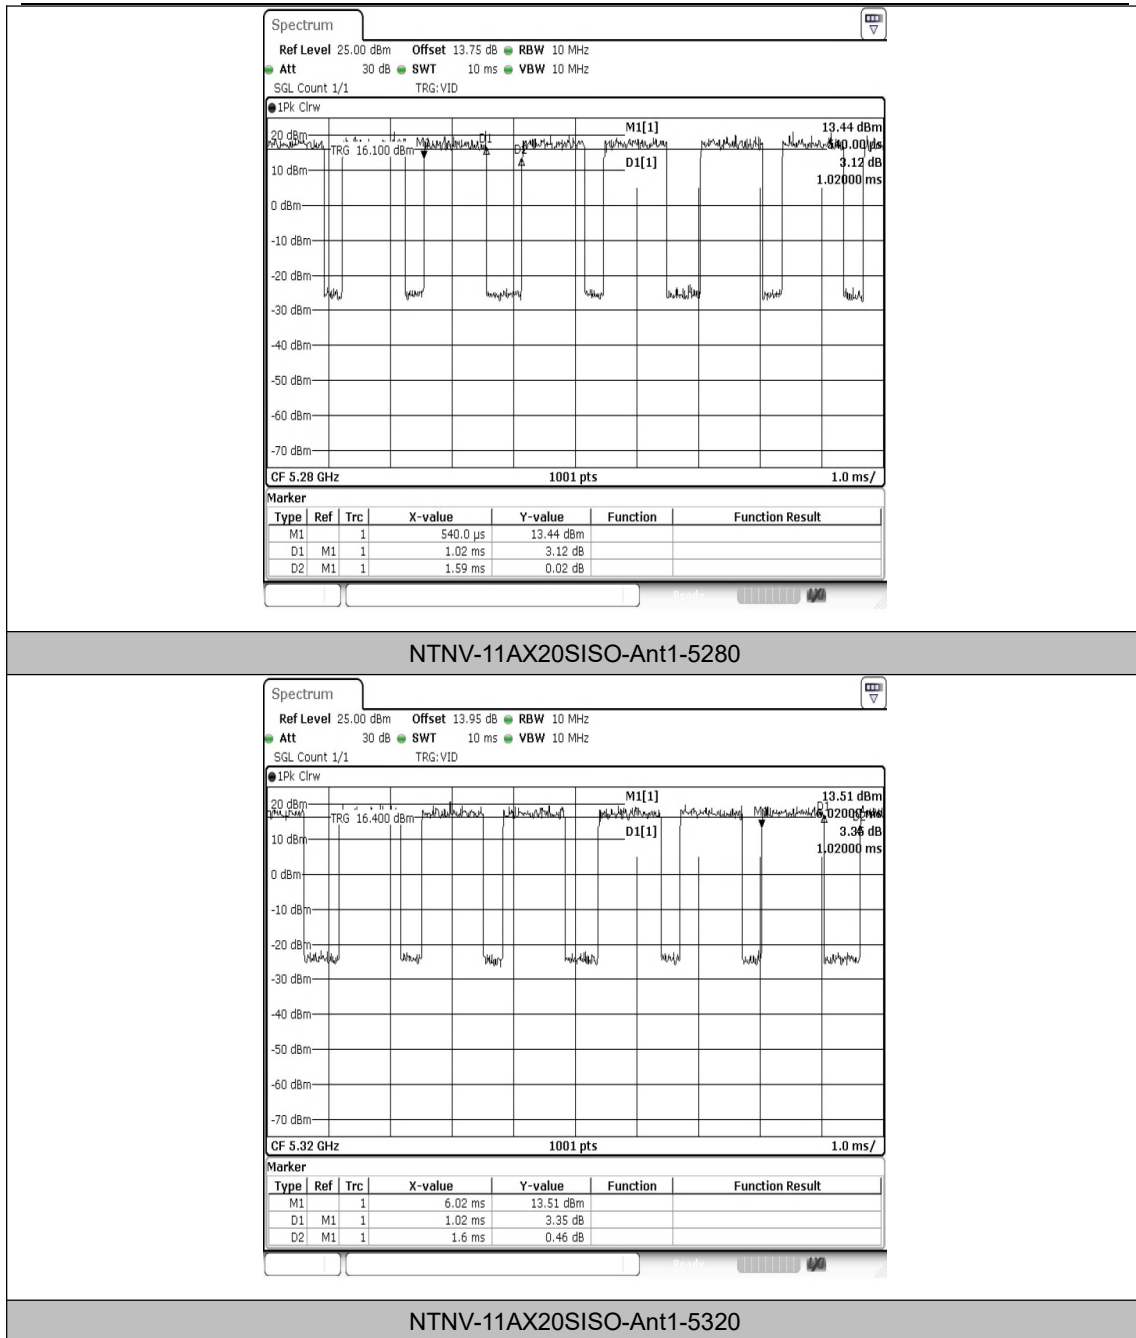


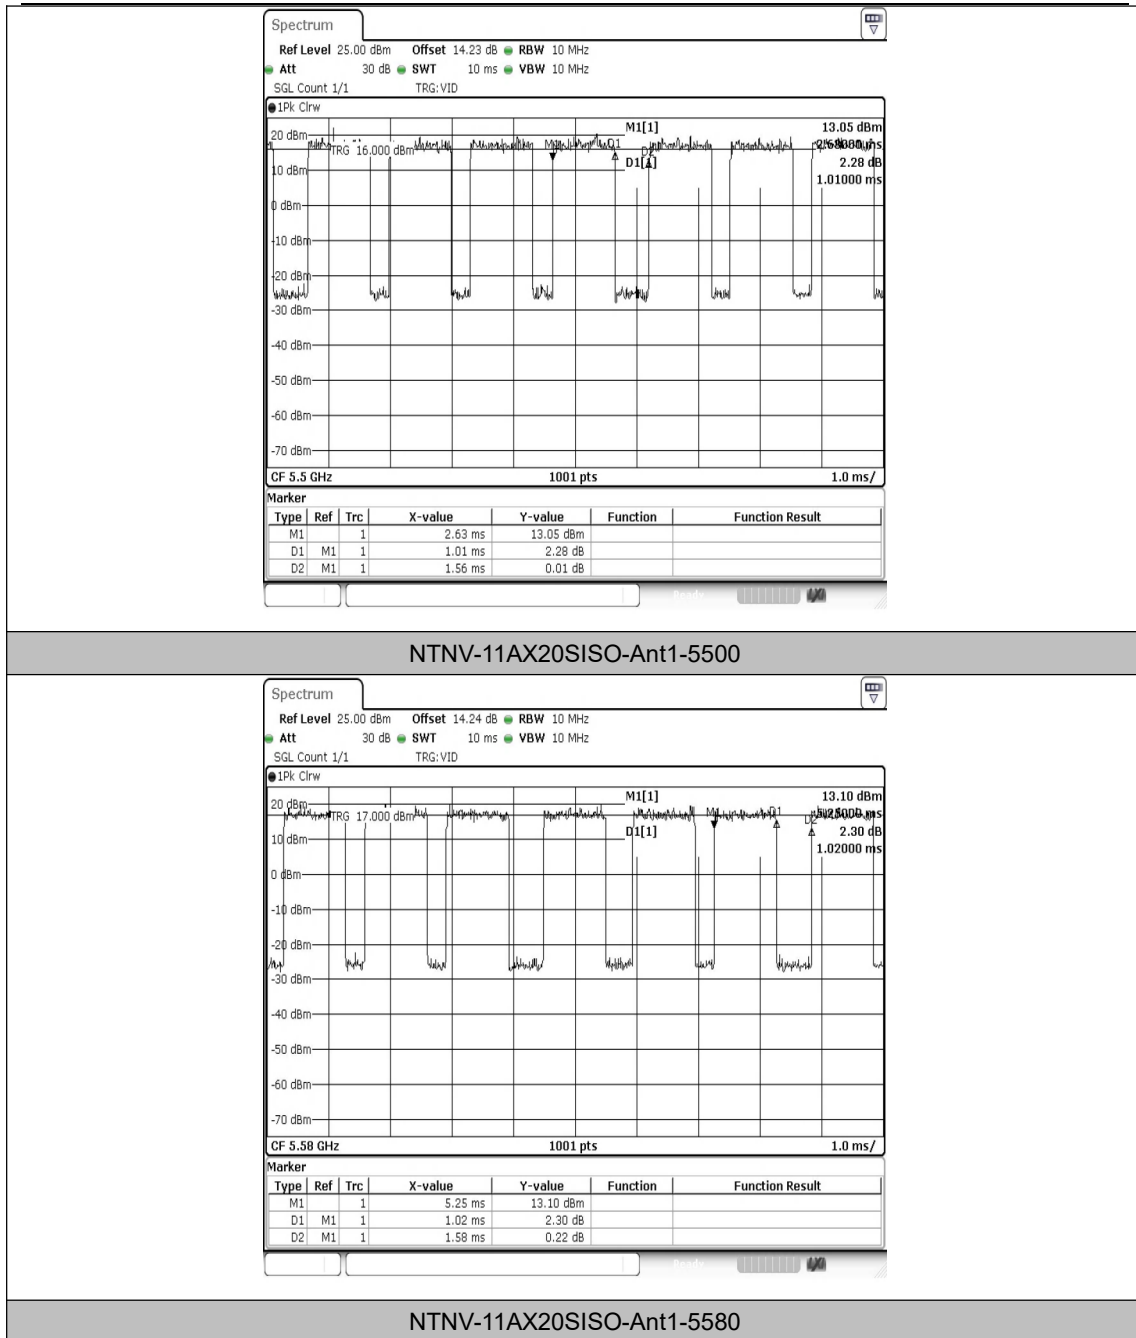


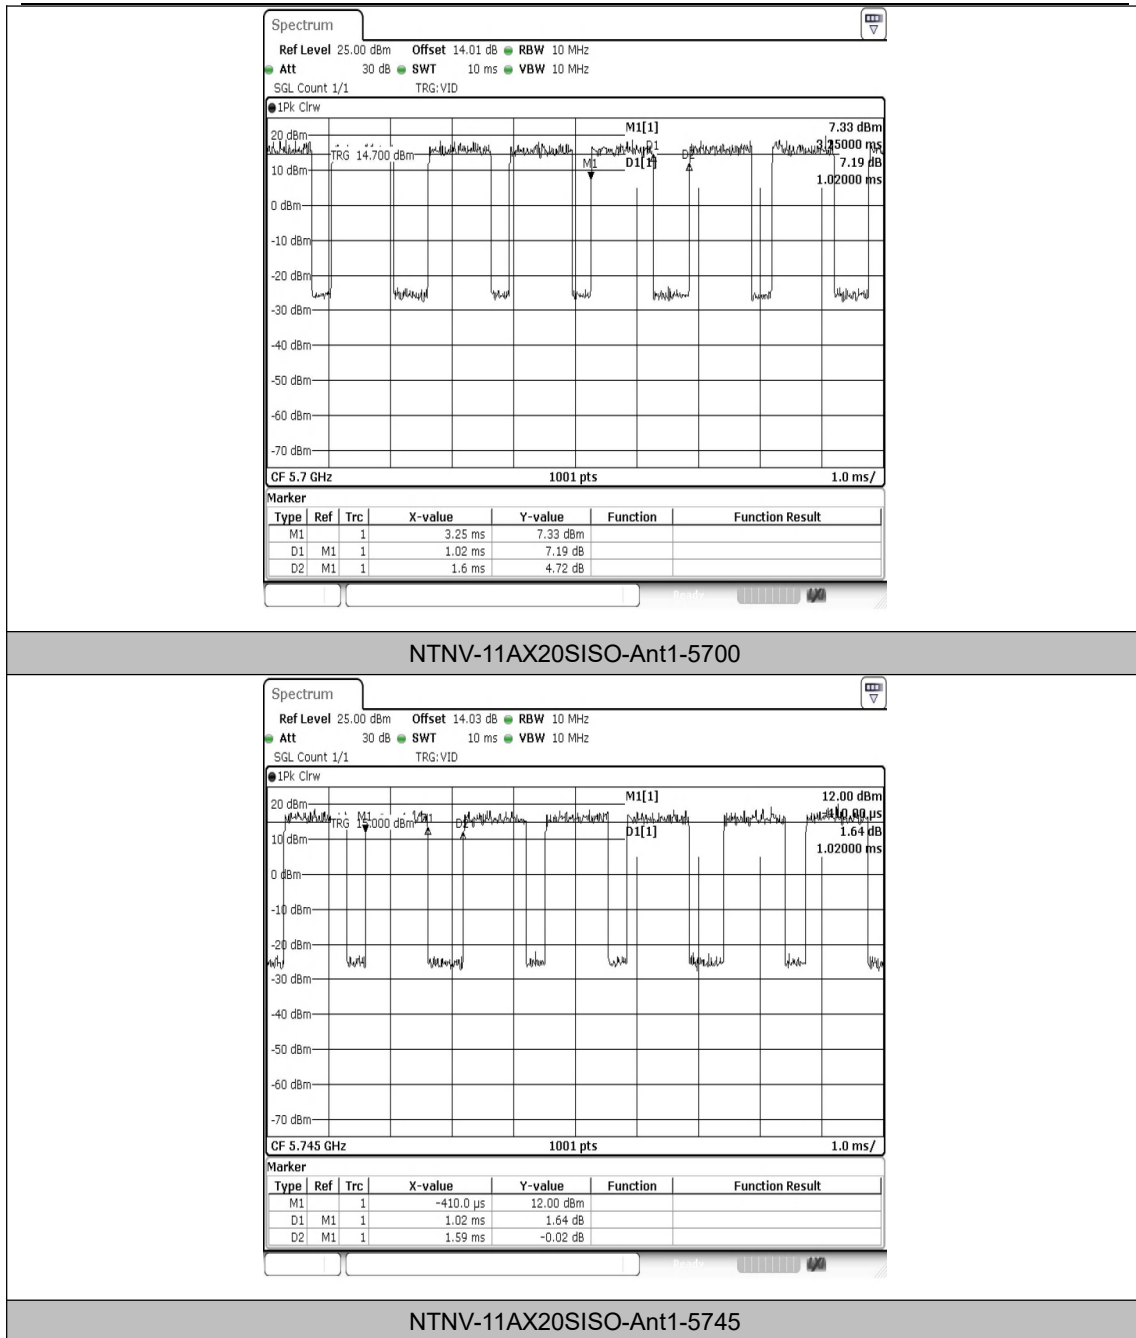


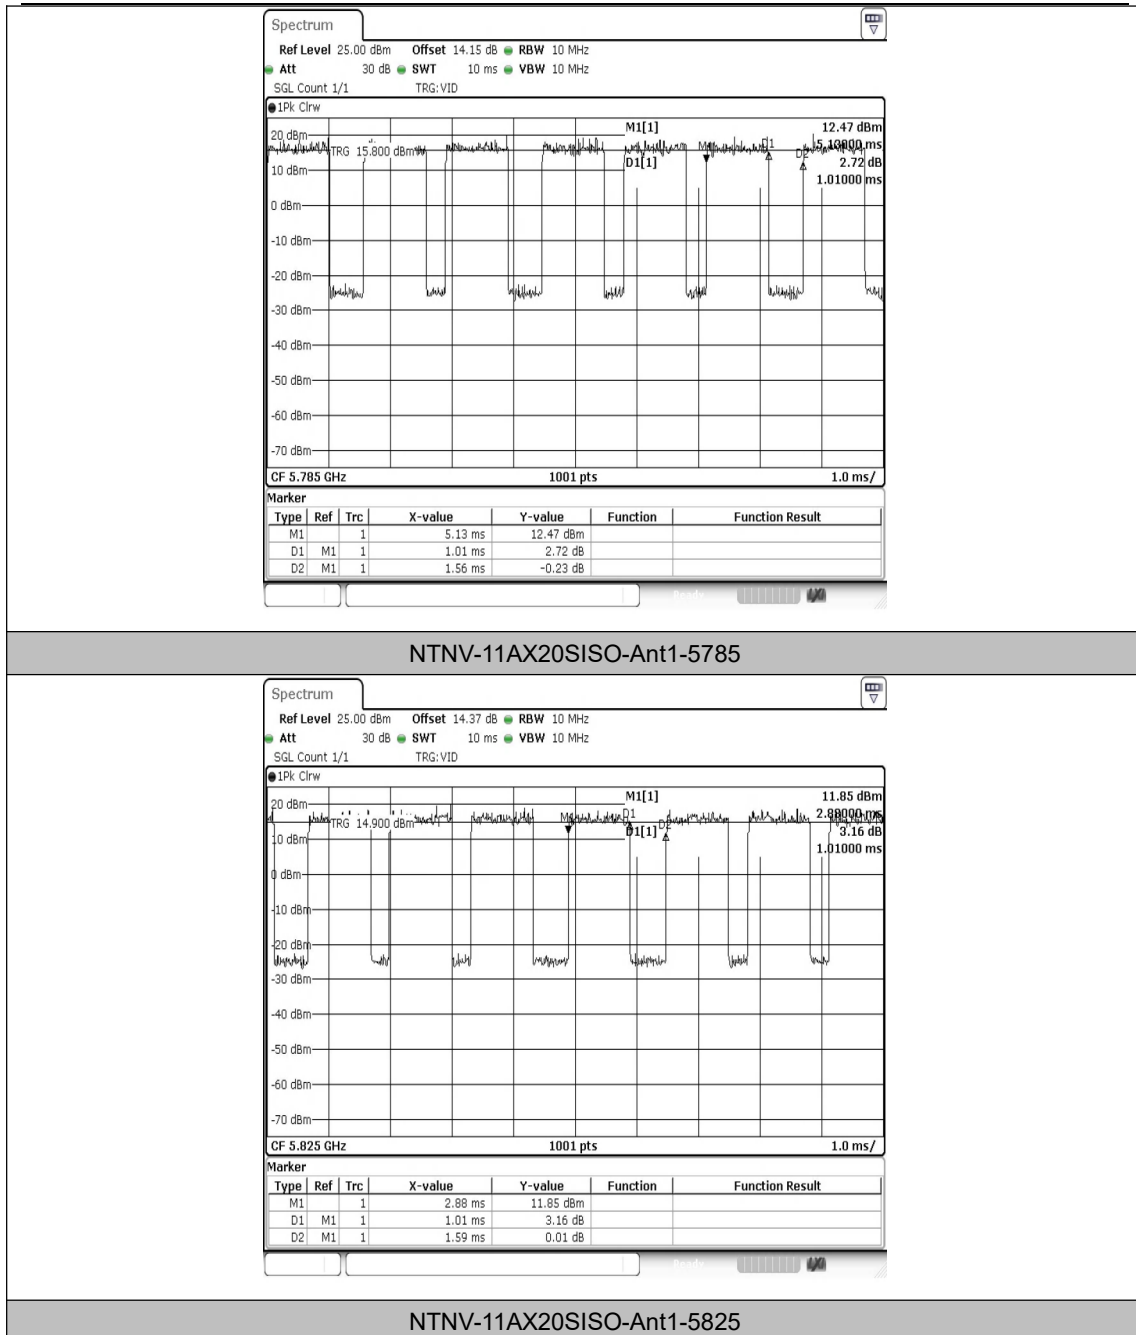


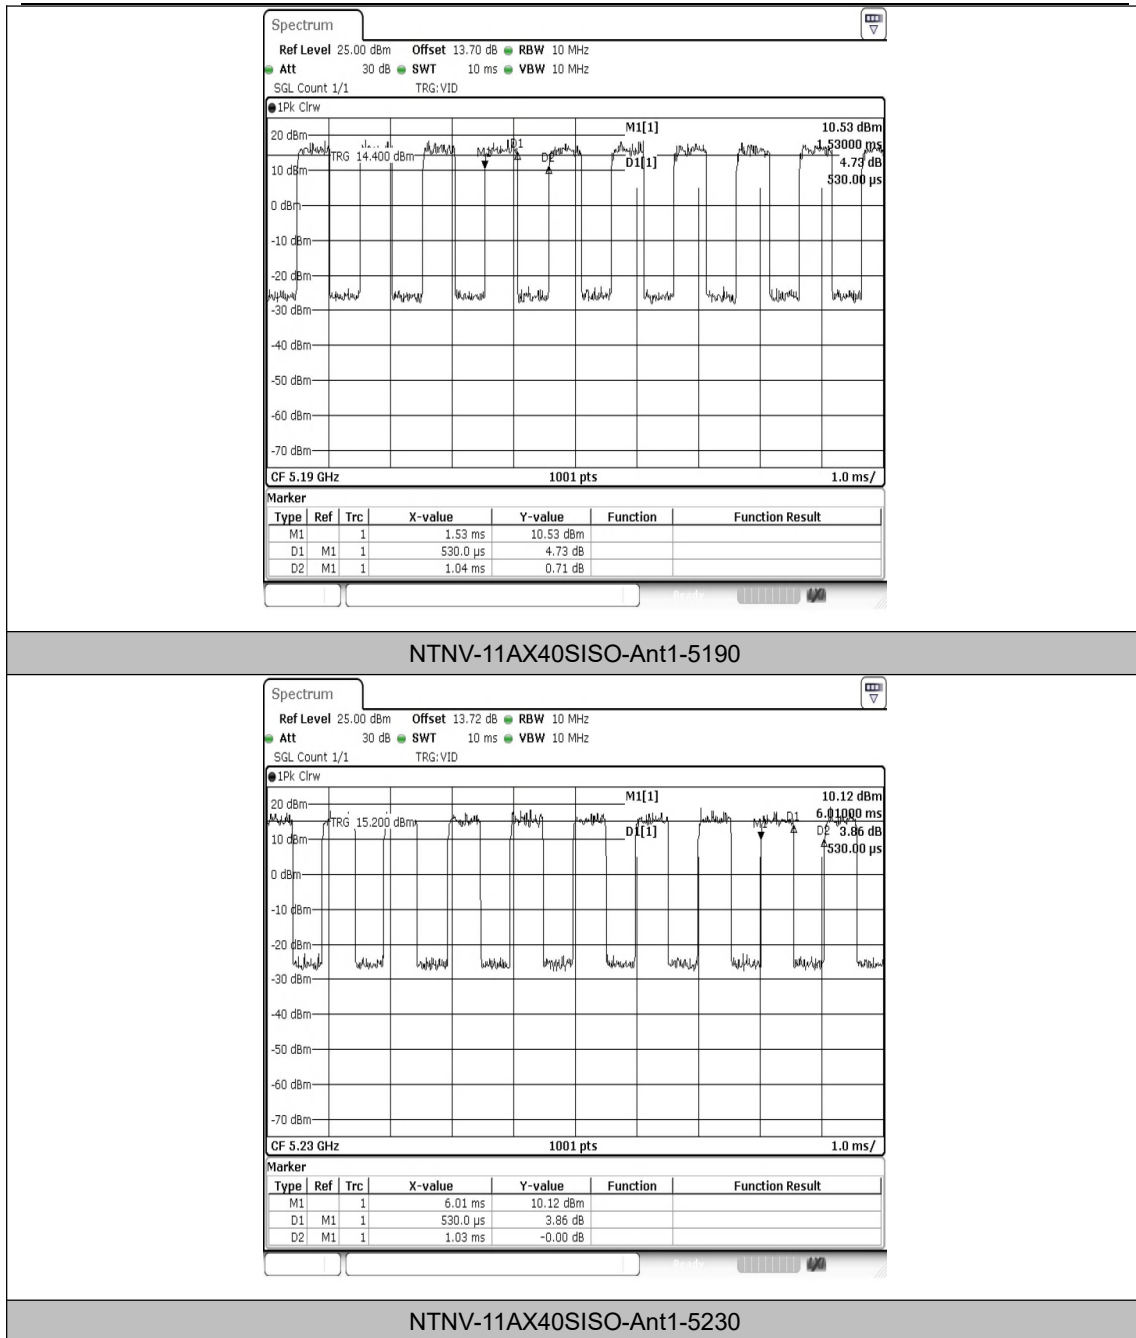

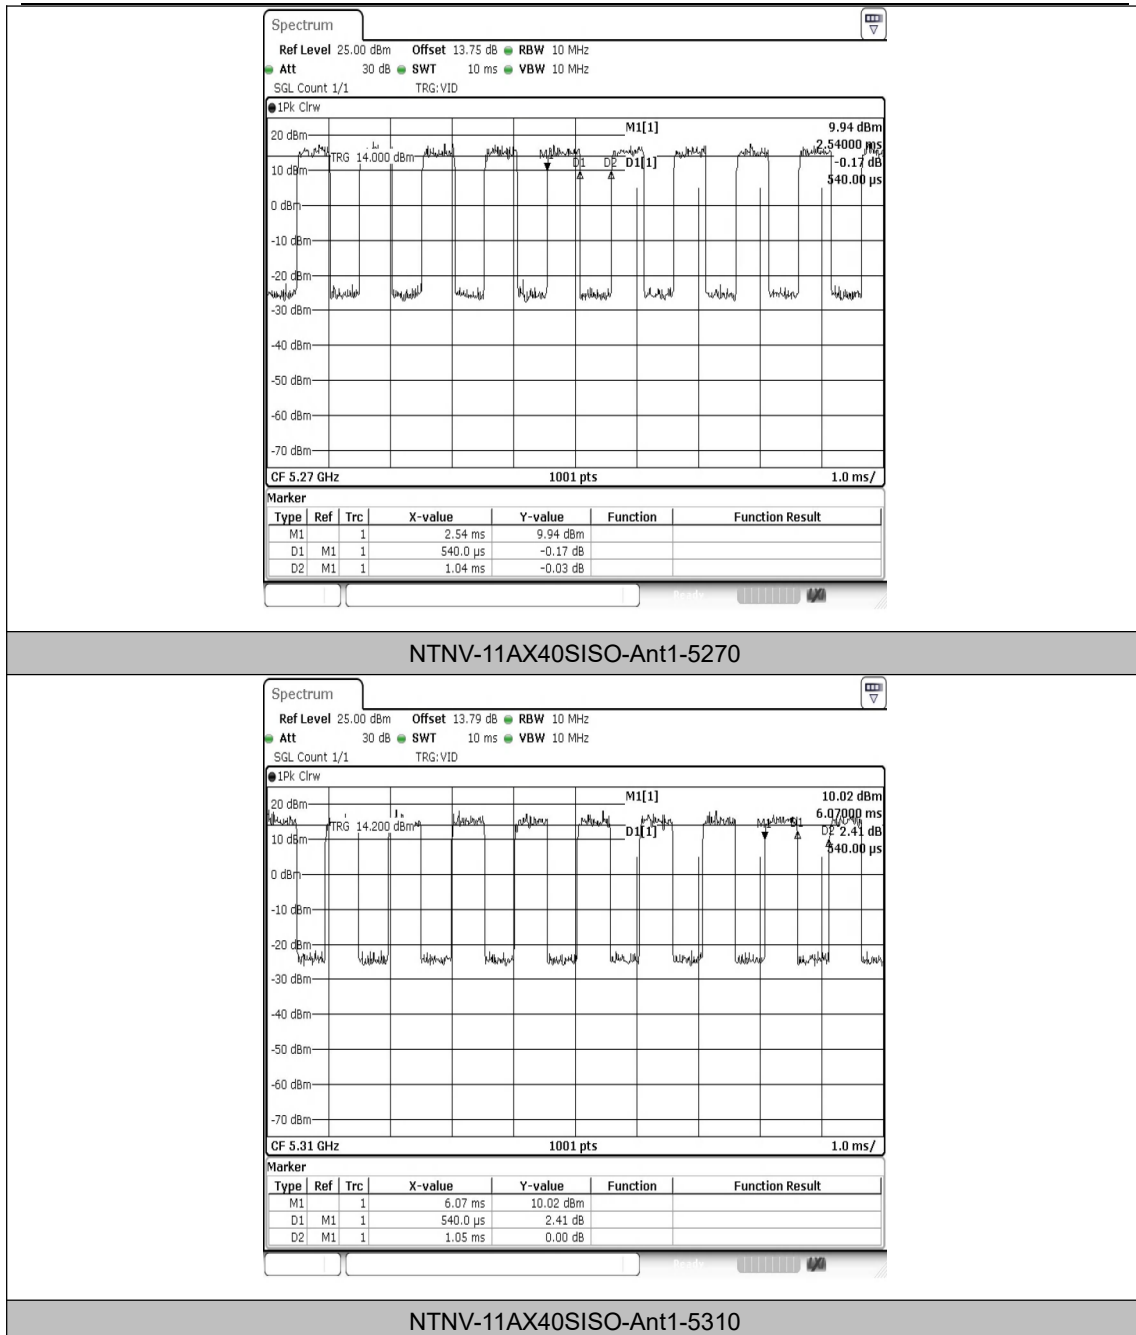

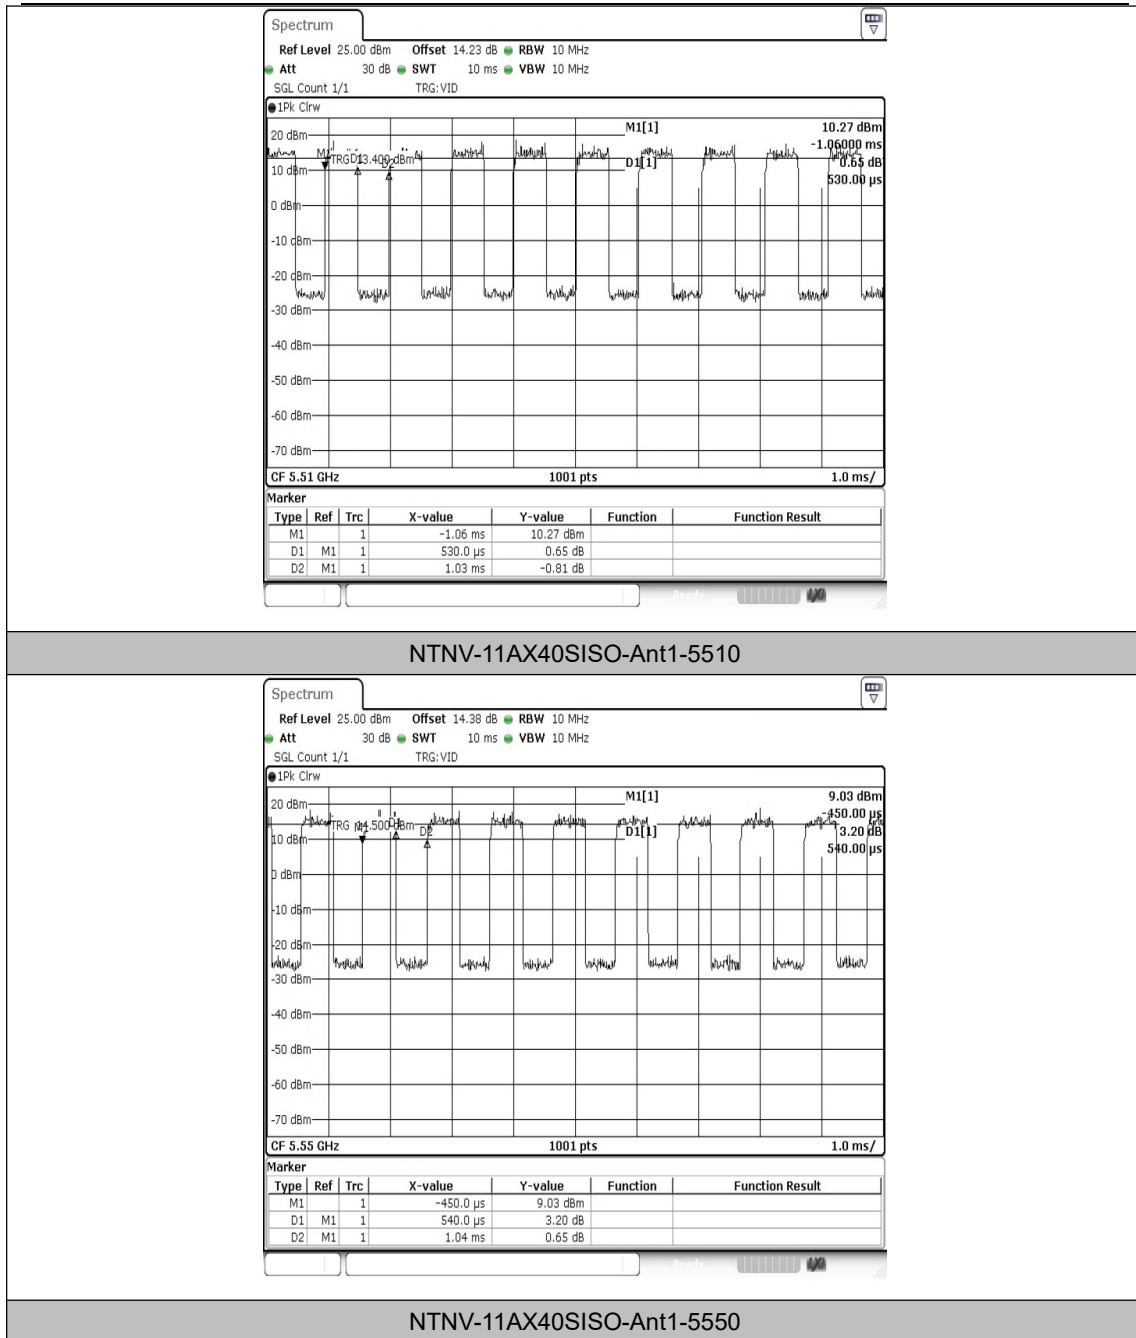

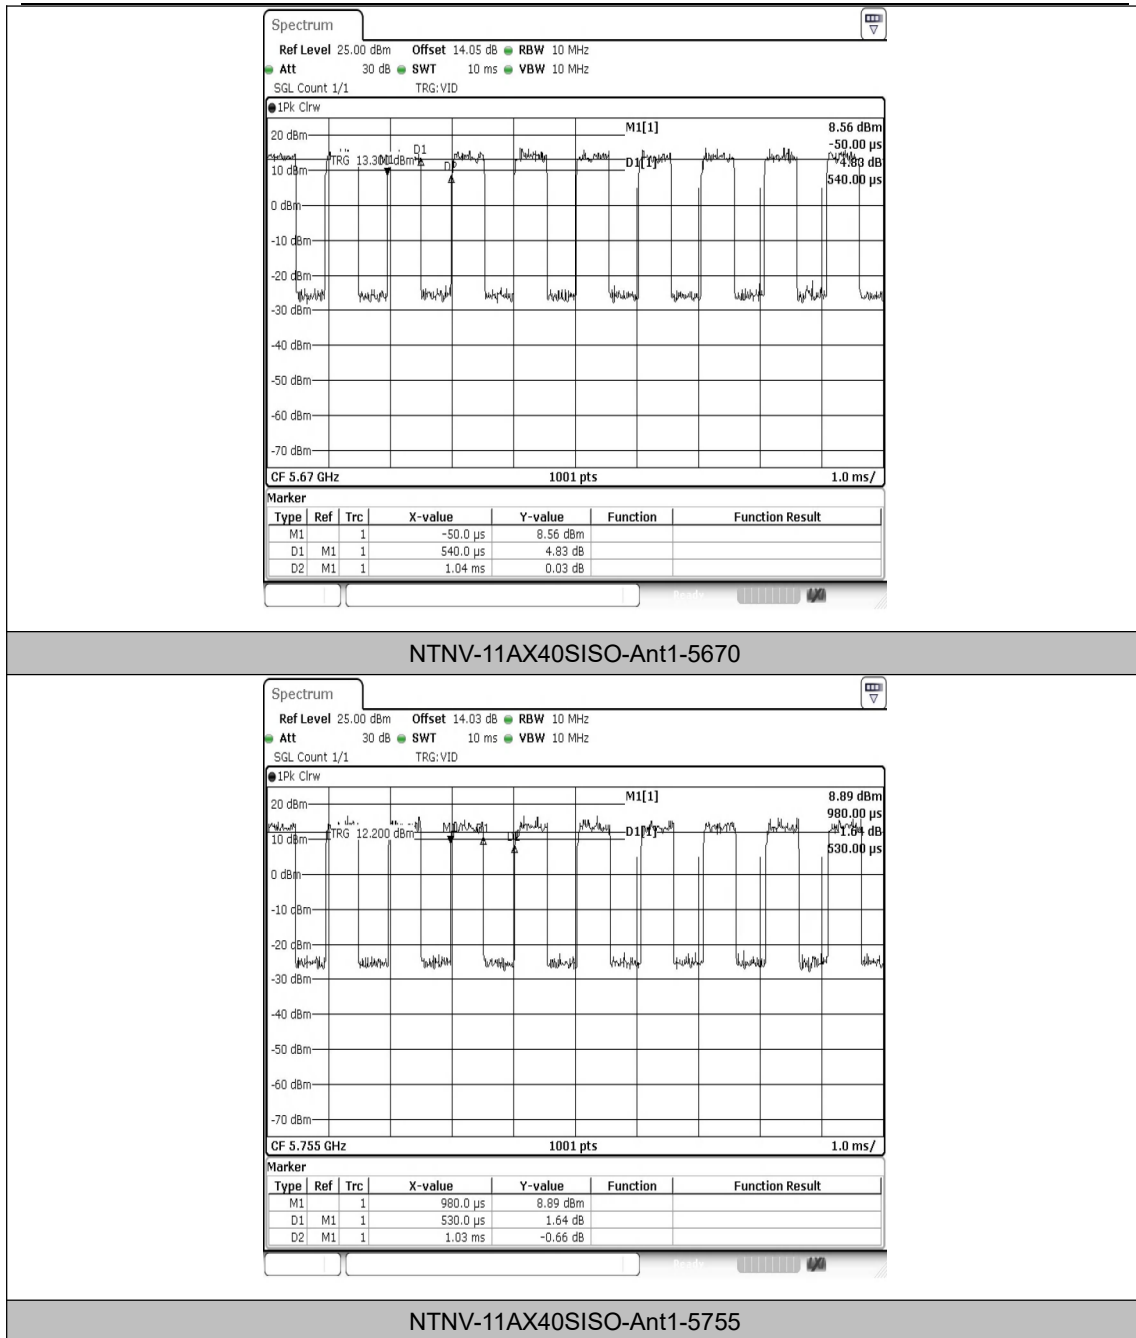

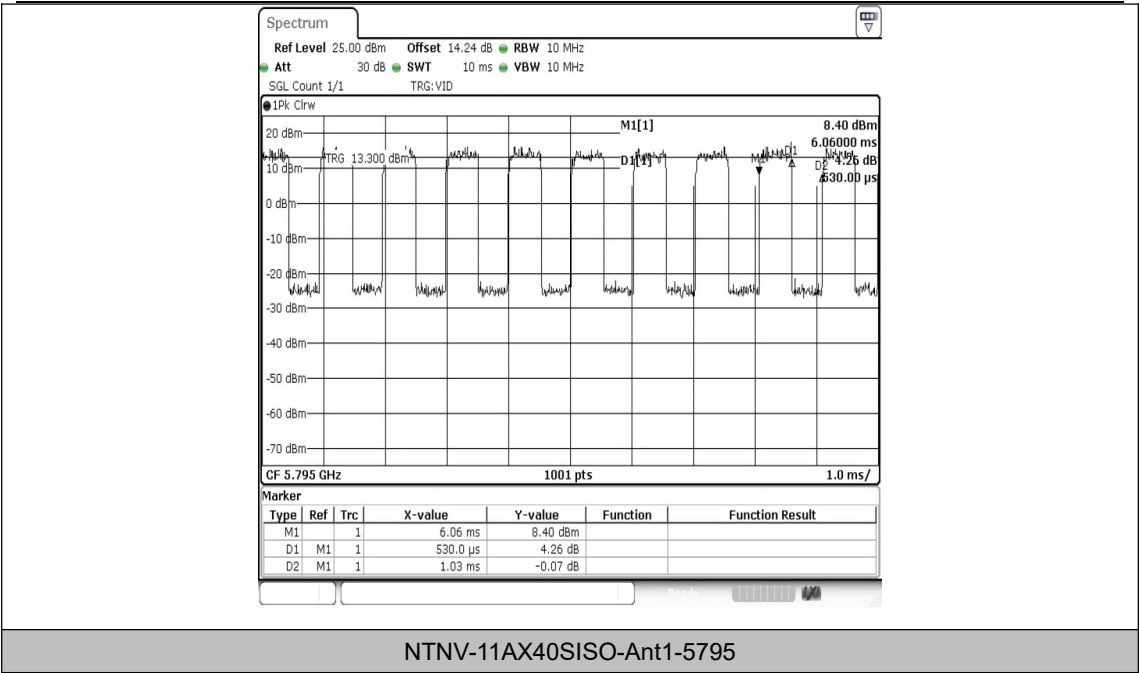

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



Appendix C: Maximum Conducted Output Power

Test Result Average

Test Mode	Antenna	Frequency[MHz]	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	11.16	72.40	1.40	12.56	≤23.98	PASS
11A	Ant1	5200	10.95	72.40	1.40	12.35	≤23.98	PASS
11A	Ant1	5240	10.53	72.40	1.40	11.93	≤23.98	PASS
11A	Ant1	5260	11.66	72.02	1.43	13.09	≤23.66	PASS
11A	Ant1	5280	10.45	72.77	1.38	11.83	≤23.66	PASS
11A	Ant1	5320	10.42	71.65	1.45	11.87	≤23.66	PASS
11A	Ant1	5500	9.84	72.40	1.40	11.24	≤23.37	PASS
11A	Ant1	5580	9.96	72.40	1.40	11.36	≤23.37	PASS
11A	Ant1	5700	8.92	72.40	1.40	10.32	≤23.37	PASS
11A	Ant1	5745	9.06	72.77	1.38	10.44	≤29.21	PASS
11A	Ant1	5785	9.21	71.79	1.44	10.65	≤29.21	PASS
11A	Ant1	5825	8.75	72.02	1.43	10.18	≤29.21	PASS
11N20SISO	Ant1	5180	10.89	70.81	1.50	12.39	≤23.98	PASS
11N20SISO	Ant1	5200	10.57	70.65	1.51	12.08	≤23.98	PASS
11N20SISO	Ant1	5240	10.15	71.04	1.48	11.63	≤23.98	PASS
11N20SISO	Ant1	5260	10.46	69.89	1.56	12.02	≤23.66	PASS
11N20SISO	Ant1	5280	10.29	71.43	1.46	11.75	≤23.66	PASS
11N20SISO	Ant1	5320	10.24	70.27	1.53	11.77	≤23.66	PASS
11N20SISO	Ant1	5500	9.71	71.43	1.46	11.17	≤23.37	PASS
11N20SISO	Ant1	5580	9.79	70.65	1.51	11.30	≤23.37	PASS
11N20SISO	Ant1	5700	8.67	71.04	1.48	10.15	≤23.37	PASS
11N20SISO	Ant1	5745	8.79	71.04	1.48	10.27	≤29.21	PASS
11N20SISO	Ant1	5785	9.66	69.89	1.56	11.22	≤29.21	PASS
11N20SISO	Ant1	5825	9.27	69.89	1.56	10.83	≤29.21	PASS
11N40SISO	Ant1	5190	10.68	62.14	2.07	12.75	≤23.98	PASS
11N40SISO	Ant1	5230	10.52	61.54	2.11	12.63	≤23.98	PASS
11N40SISO	Ant1	5270	10.34	61.54	2.11	12.45	≤23.66	PASS
11N40SISO	Ant1	5310	10.25	61.54	2.11	12.36	≤23.66	PASS
11N40SISO	Ant1	5510	9.83	44.22	3.54	13.37	≤23.37	PASS
11N40SISO	Ant1	5550	10.10	62.50	2.04	12.14	≤23.37	PASS
11N40SISO	Ant1	5670	8.93	62.75	2.02	10.95	≤23.37	PASS
11N40SISO	Ant1	5755	8.64	60.95	2.15	10.79	≤29.21	PASS
11N40SISO	Ant1	5795	8.74	62.50	2.04	10.78	≤29.21	PASS
11AC20SISO	Ant1	5180	11.53	70.43	1.52	13.05	≤23.98	PASS
11AC20SISO	Ant1	5200	11.31	69.68	1.57	12.88	≤23.98	PASS
11AC20SISO	Ant1	5240	10.96	70.43	1.52	12.48	≤23.98	PASS



11AC20SISO	Ant1	5260	11.04	69.15	1.60	12.64	≤23.66	PASS
11AC20SISO	Ant1	5280	10.96	75.72	1.21	12.17	≤23.66	PASS
11AC20SISO	Ant1	5320	10.96	70.81	1.50	12.46	≤23.66	PASS
11AC20SISO	Ant1	5500	10.43	70.81	1.50	11.93	≤23.37	PASS
11AC20SISO	Ant1	5580	10.44	69.68	1.57	12.01	≤23.37	PASS
11AC20SISO	Ant1	5700	9.24	70.43	1.52	10.76	≤23.37	PASS
11AC20SISO	Ant1	5745	9.49	56.96	2.44	11.93	≤29.21	PASS
11AC20SISO	Ant1	5785	9.62	70.43	1.52	11.14	≤29.21	PASS
11AC20SISO	Ant1	5825	9.26	70.43	1.52	10.78	≤29.21	PASS
11AC40SISO	Ant1	5190	10.88	62.50	2.04	12.92	≤23.98	PASS
11AC40SISO	Ant1	5230	10.57	63.73	1.96	12.53	≤23.98	PASS
11AC40SISO	Ant1	5270	10.42	62.50	2.04	12.46	≤23.66	PASS
11AC40SISO	Ant1	5310	10.33	63.73	1.96	12.29	≤23.66	PASS
11AC40SISO	Ant1	5510	9.97	55.56	2.55	12.52	≤23.37	PASS
11AC40SISO	Ant1	5550	10.19	63.11	2.00	12.19	≤23.37	PASS
11AC40SISO	Ant1	5670	9.07	63.73	1.96	11.03	≤23.37	PASS
11AC40SISO	Ant1	5755	8.77	62.50	2.04	10.81	≤29.21	PASS
11AC40SISO	Ant1	5795	8.83	61.32	2.12	10.95	≤29.21	PASS
11AX20SISO	Ant1	5180	11.48	64.33	1.92	13.40	≤23.98	PASS
11AX20SISO	Ant1	5200	11.26	64.33	1.92	13.18	≤23.98	PASS
11AX20SISO	Ant1	5240	10.92	64.15	1.93	12.85	≤23.98	PASS
11AX20SISO	Ant1	5260	11.02	63.52	1.97	12.99	≤23.66	PASS
11AX20SISO	Ant1	5280	10.89	64.15	1.93	12.82	≤23.66	PASS
11AX20SISO	Ant1	5320	10.88	63.75	1.96	12.84	≤23.66	PASS
11AX20SISO	Ant1	5500	10.40	64.74	1.89	12.29	≤23.37	PASS
11AX20SISO	Ant1	5580	10.41	64.56	1.90	12.31	≤23.37	PASS
11AX20SISO	Ant1	5700	9.19	63.75	1.96	11.15	≤23.37	PASS
11AX20SISO	Ant1	5745	9.38	64.15	1.93	11.31	≤29.21	PASS
11AX20SISO	Ant1	5785	9.57	64.74	1.89	11.46	≤29.21	PASS
11AX20SISO	Ant1	5825	9.18	63.52	1.97	11.15	≤29.21	PASS
11AX40SISO	Ant1	5190	10.30	50.96	2.93	13.23	≤23.98	PASS
11AX40SISO	Ant1	5230	9.97	51.46	2.89	12.86	≤23.98	PASS
11AX40SISO	Ant1	5270	9.79	51.92	2.85	12.64	≤23.66	PASS
11AX40SISO	Ant1	5310	9.71	51.43	2.89	12.60	≤23.66	PASS
11AX40SISO	Ant1	5510	9.33	51.46	2.89	12.22	≤23.37	PASS
11AX40SISO	Ant1	5550	9.54	51.92	2.85	12.39	≤23.37	PASS
11AX40SISO	Ant1	5670	8.41	51.92	2.85	11.26	≤23.37	PASS
11AX40SISO	Ant1	5755	8.17	51.46	2.89	11.06	≤29.21	PASS
11AX40SISO	Ant1	5795	8.26	51.46	2.89	11.15	≤29.21	PASS

Note: 1.The cable loss are compensated in the graph.

2.As Directional gain= $10 \log[(10^{G1/20} + 10^{G2/20})^2 / N_{ANT}]$ dBi,

So Limit(dBm)=Limit_{B2/B3/B4}-(Directional gain-6.00).

Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



Test Graphs Average

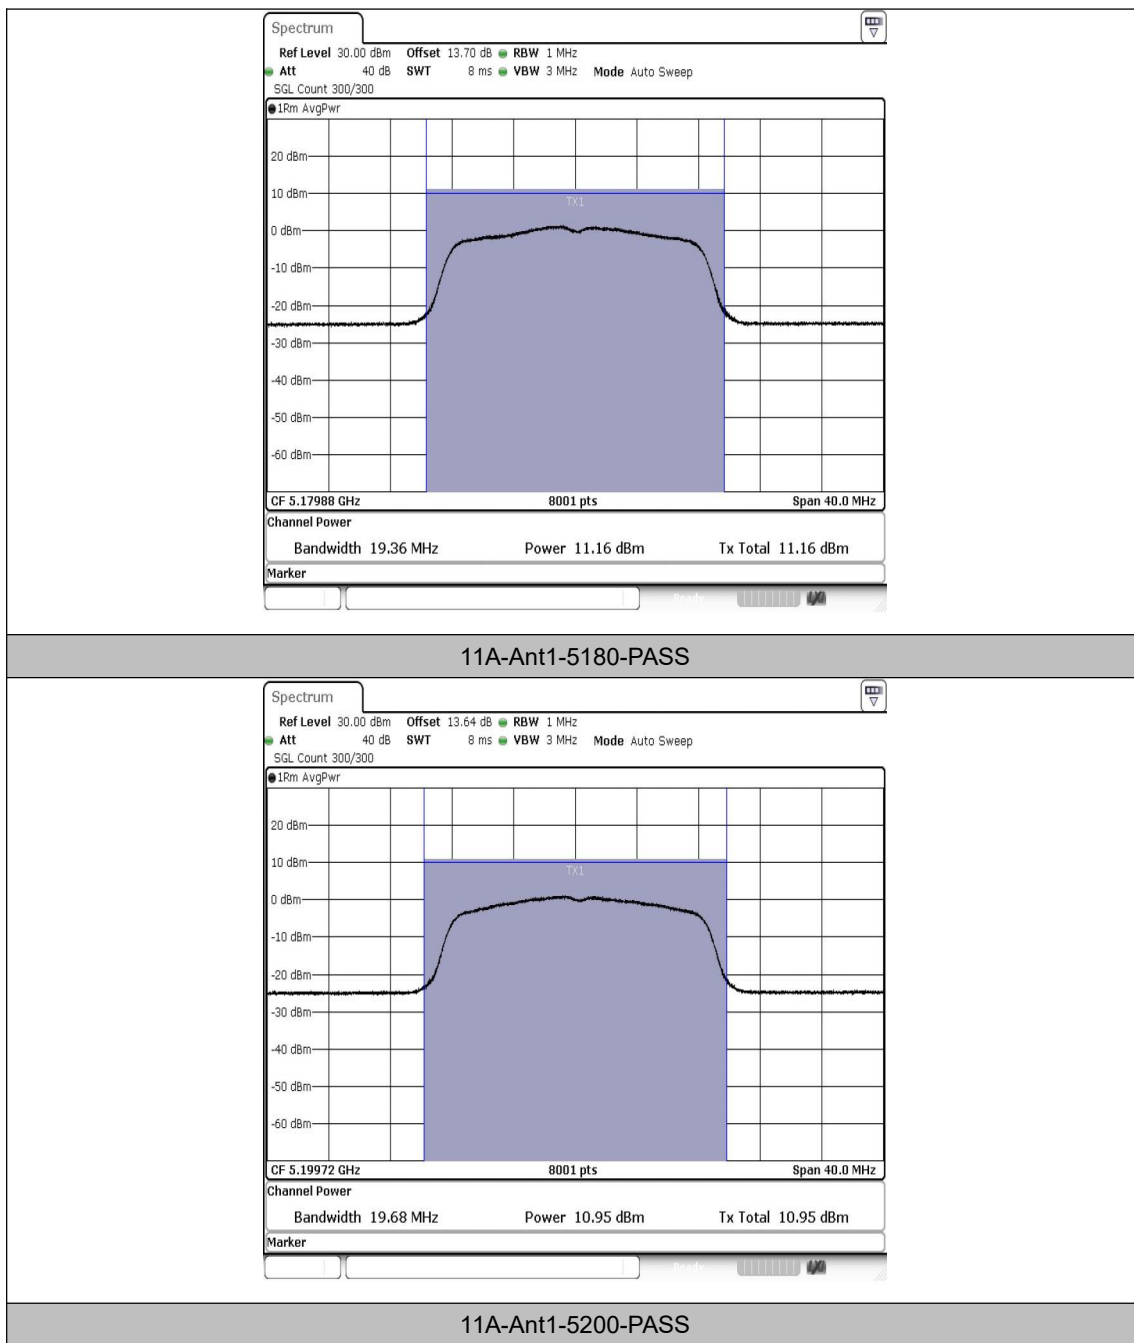



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



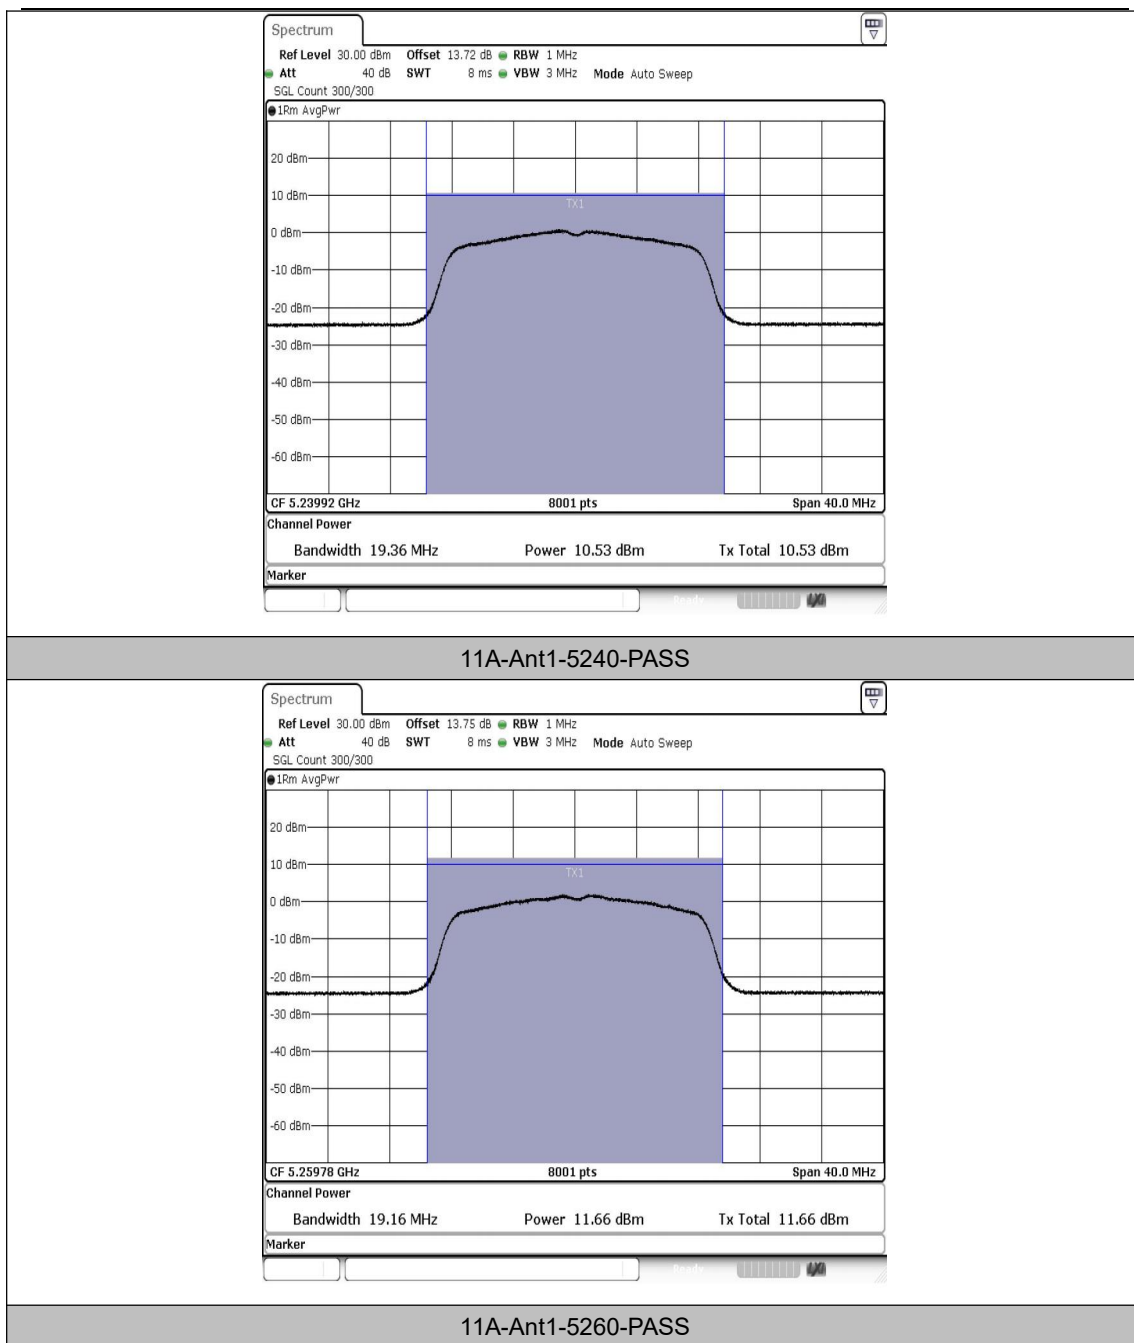

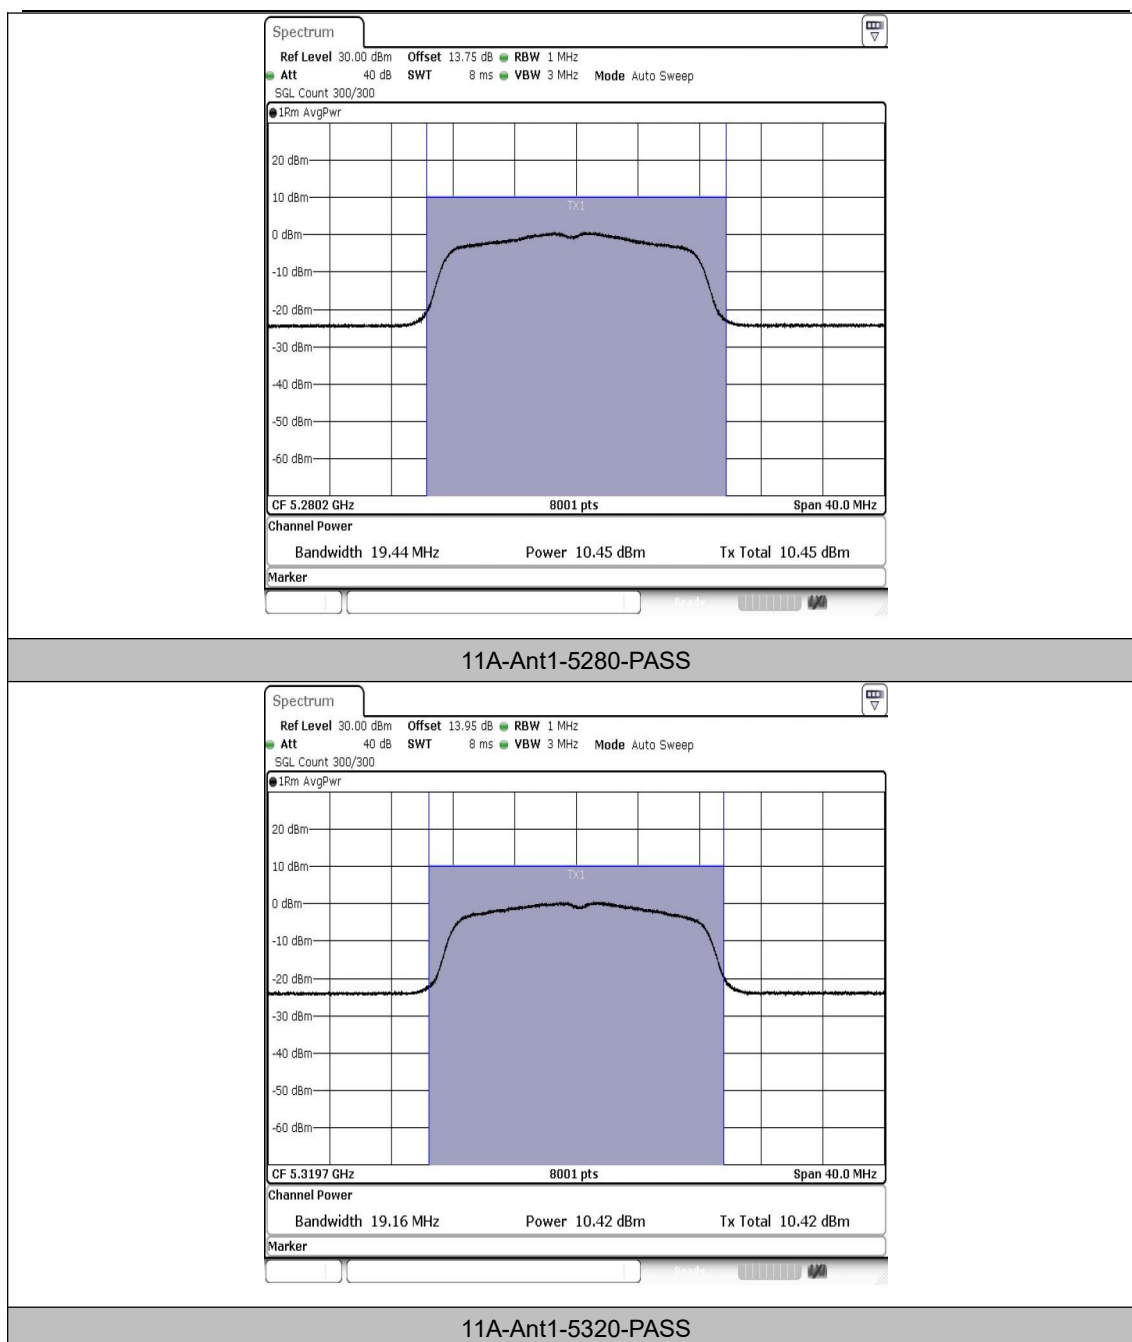

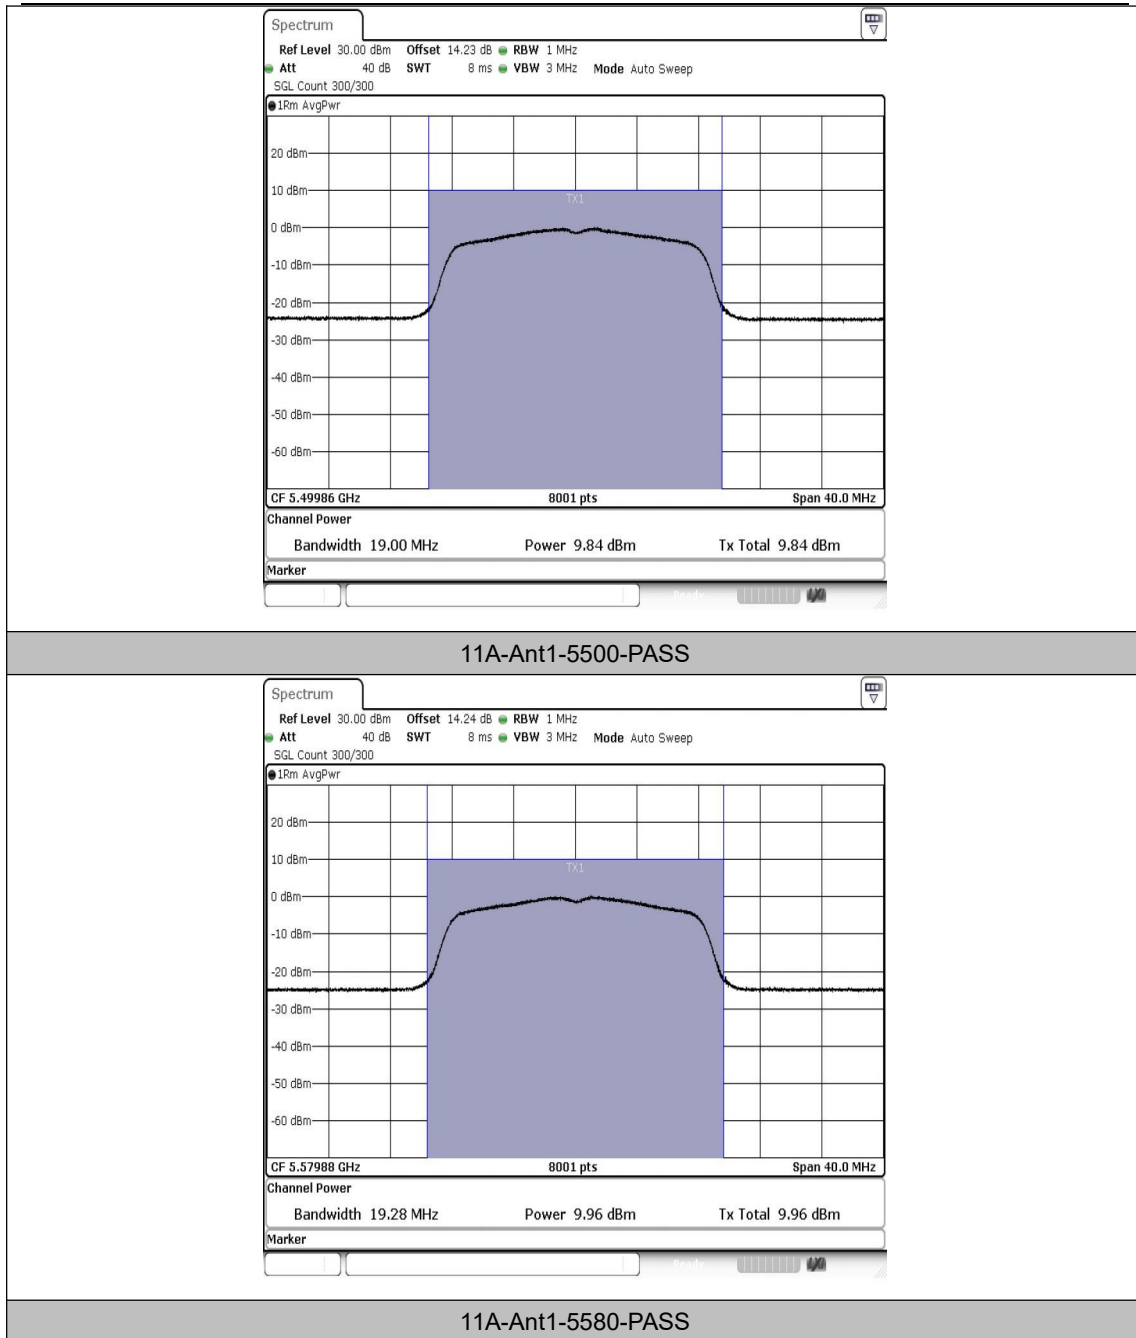

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



