




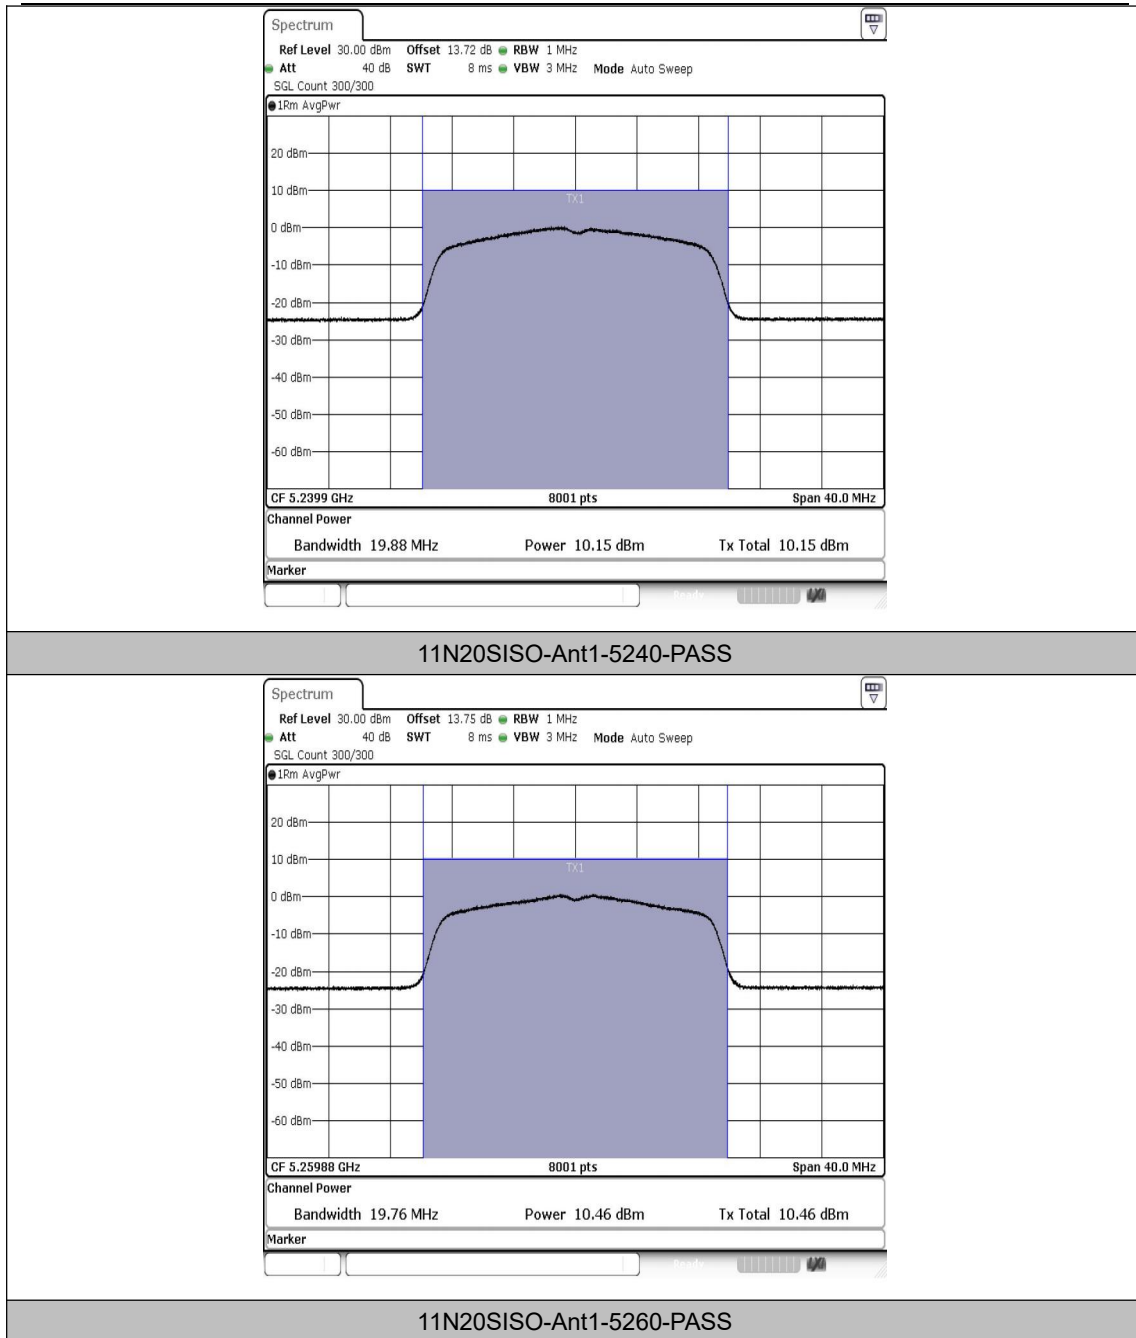

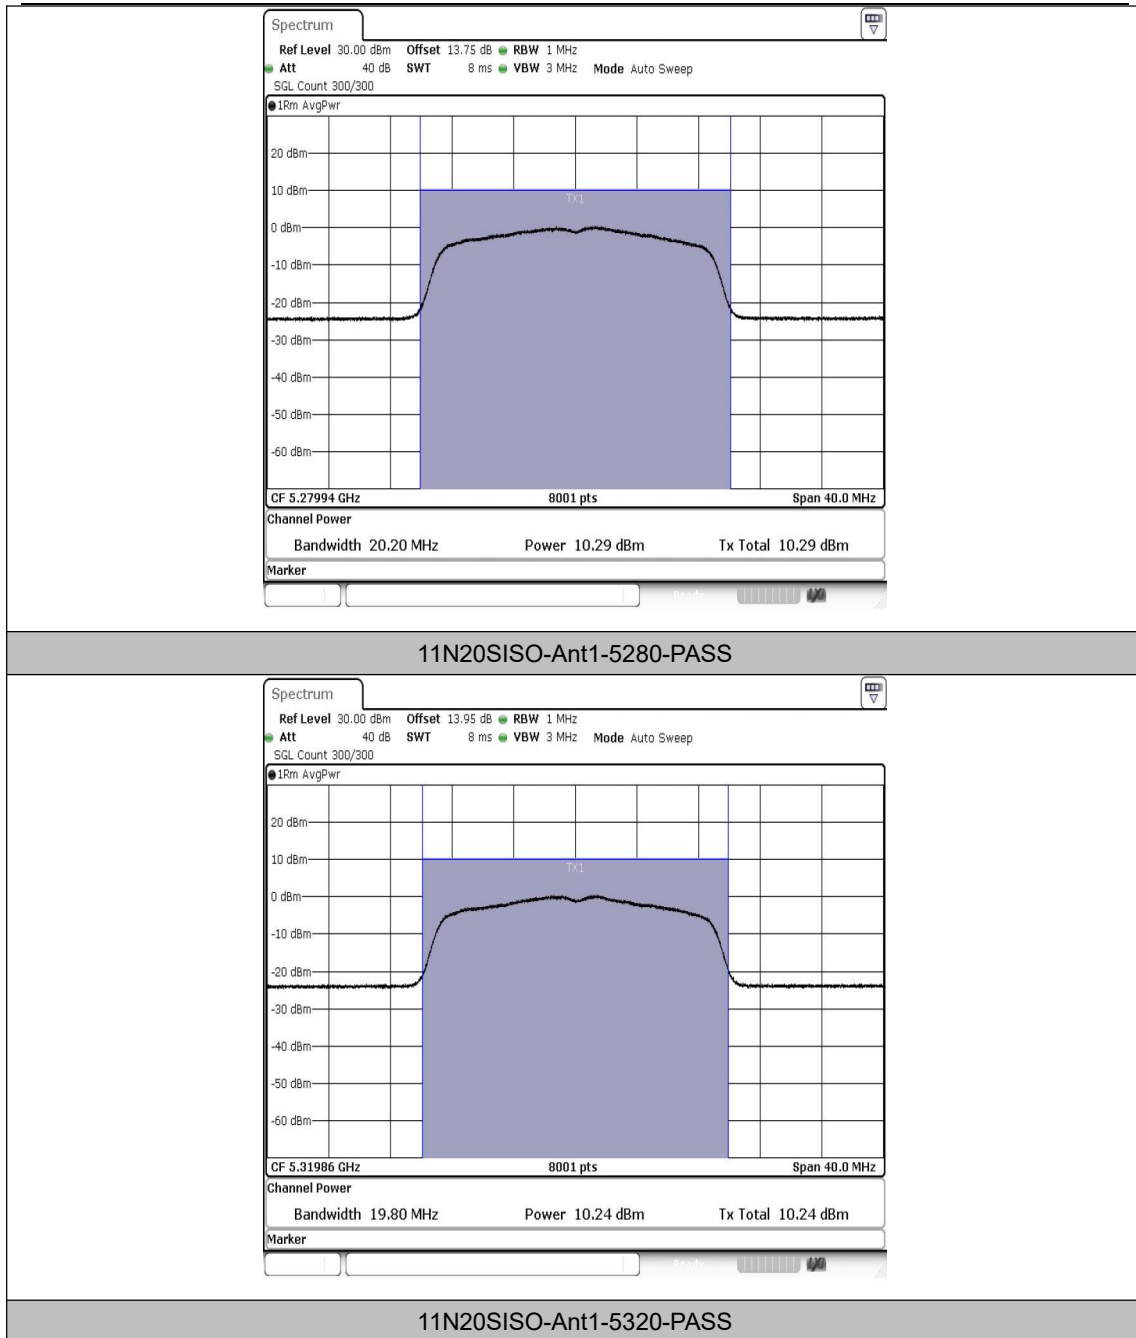

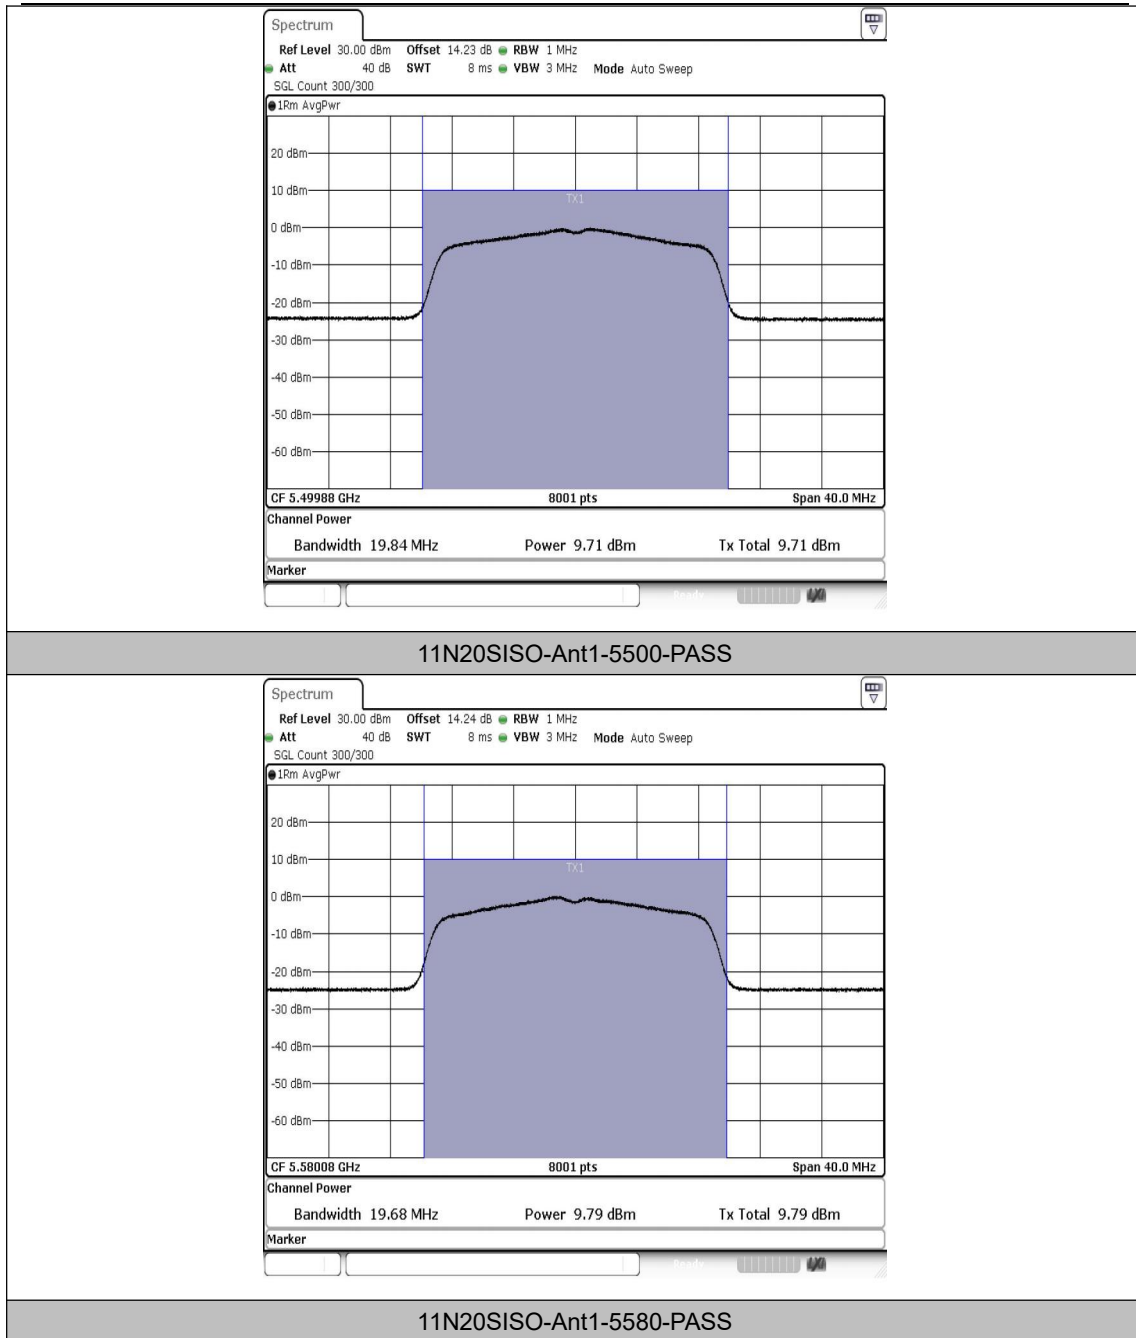



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com




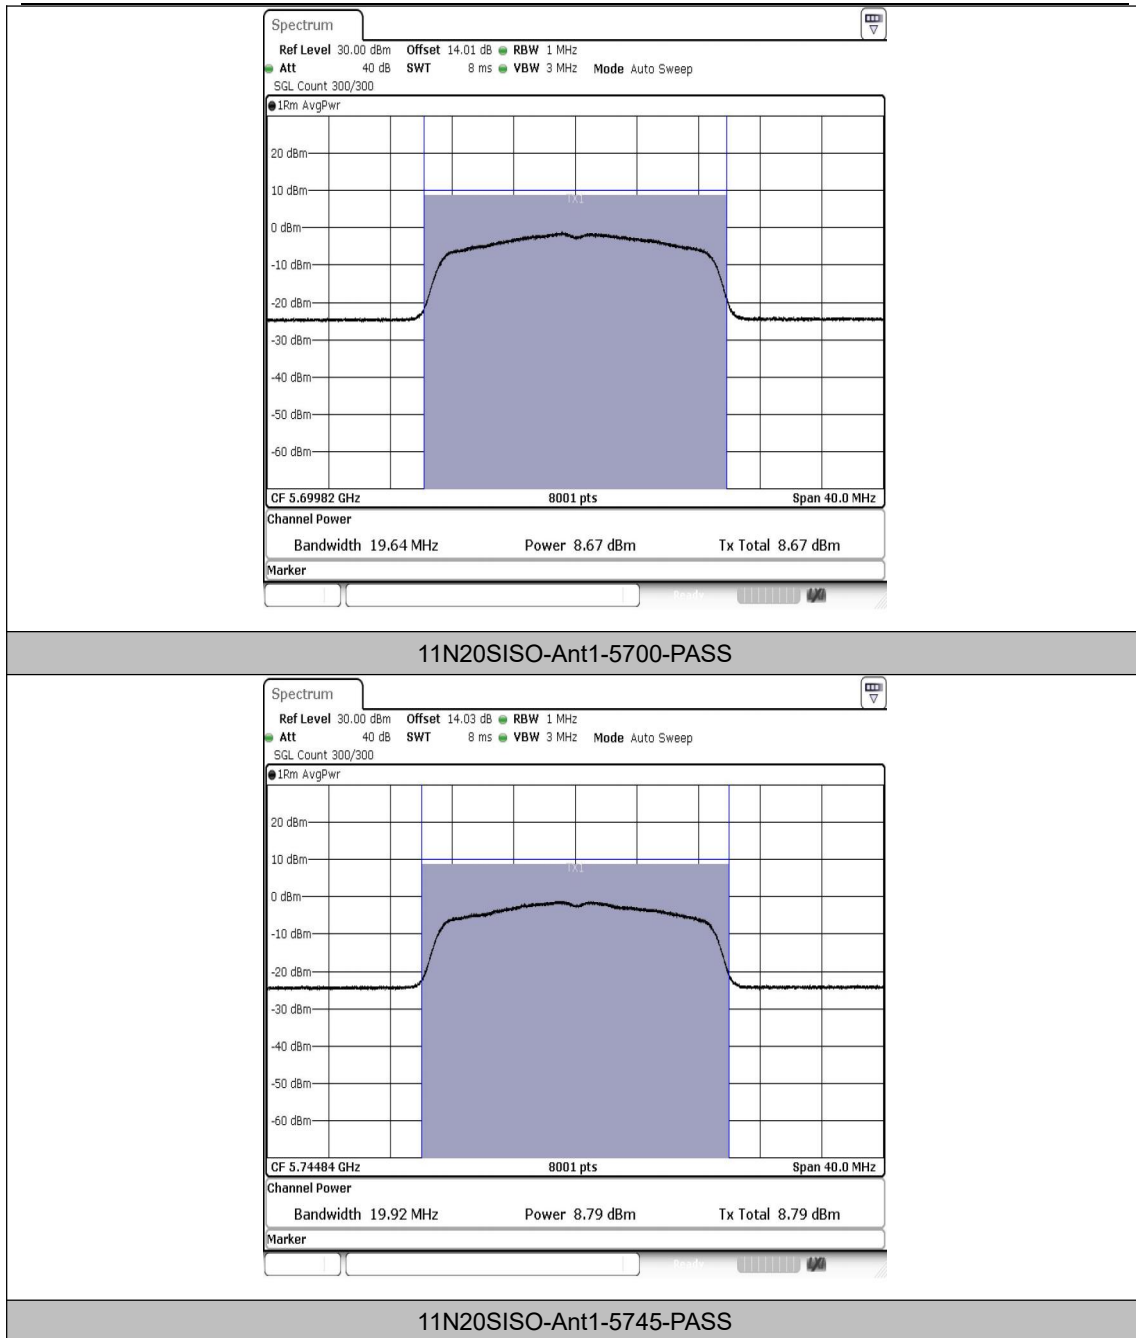


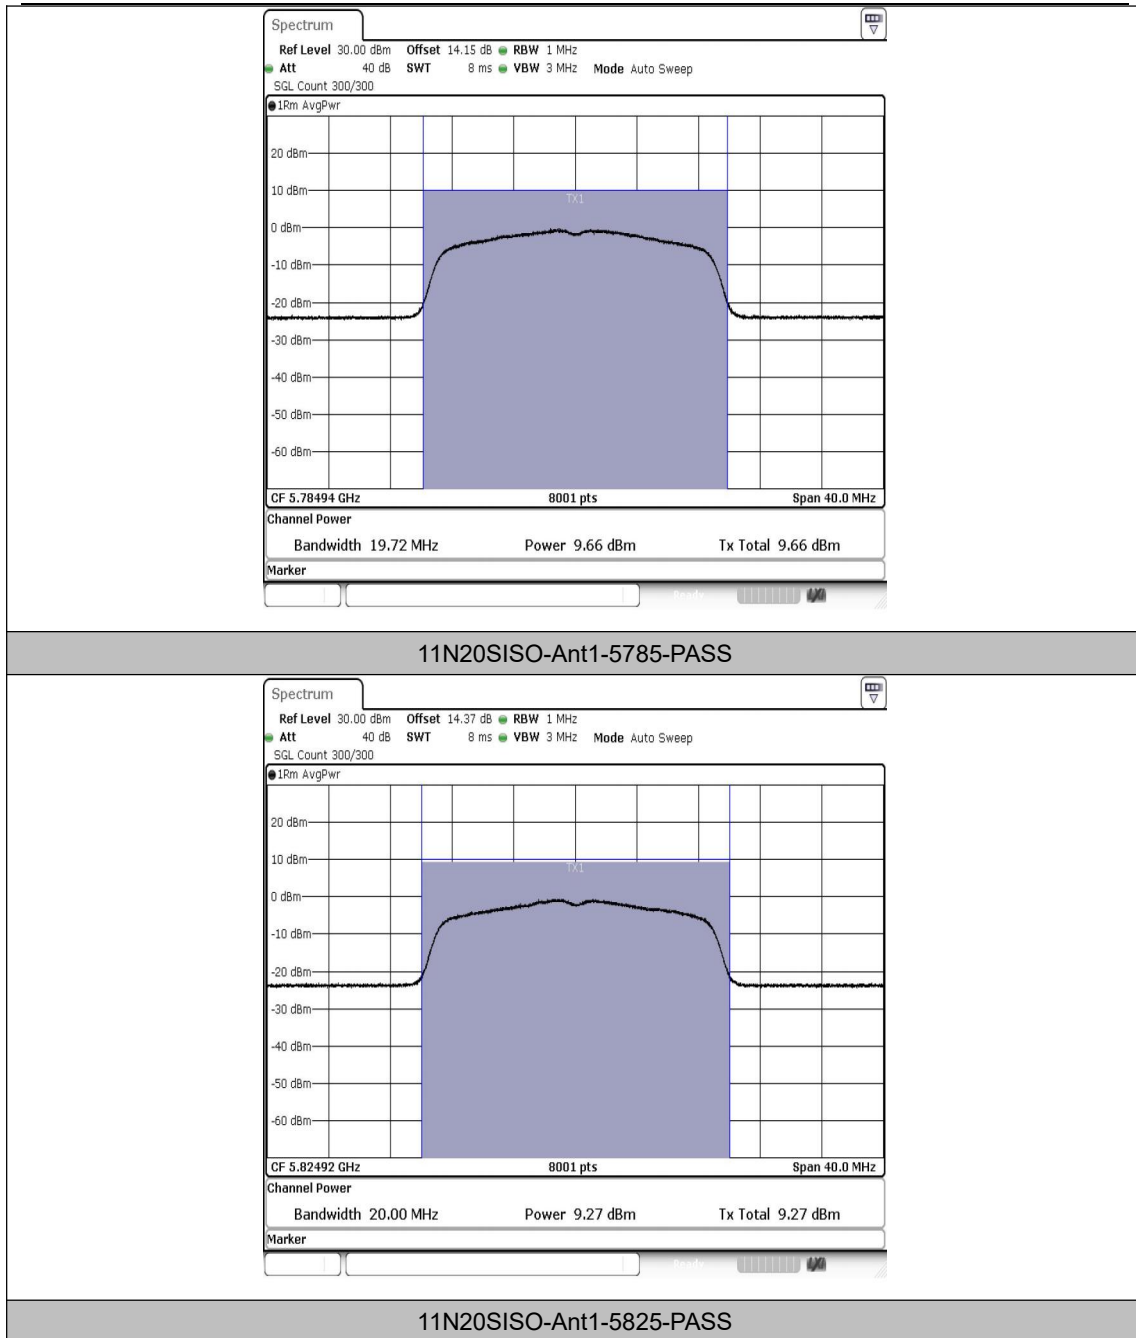


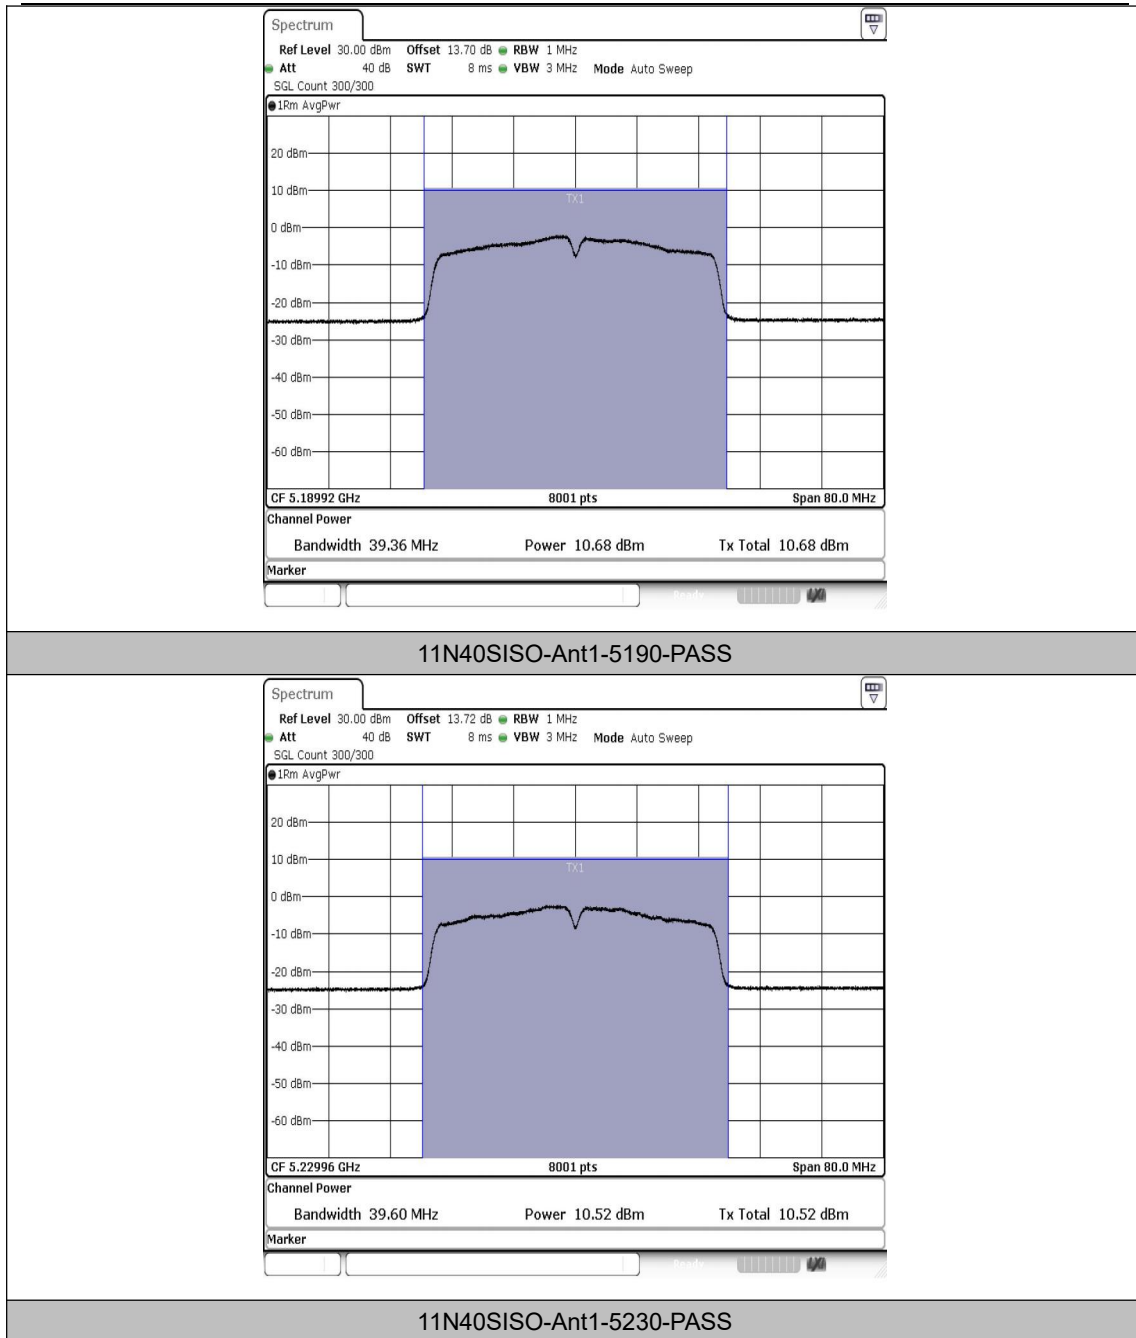


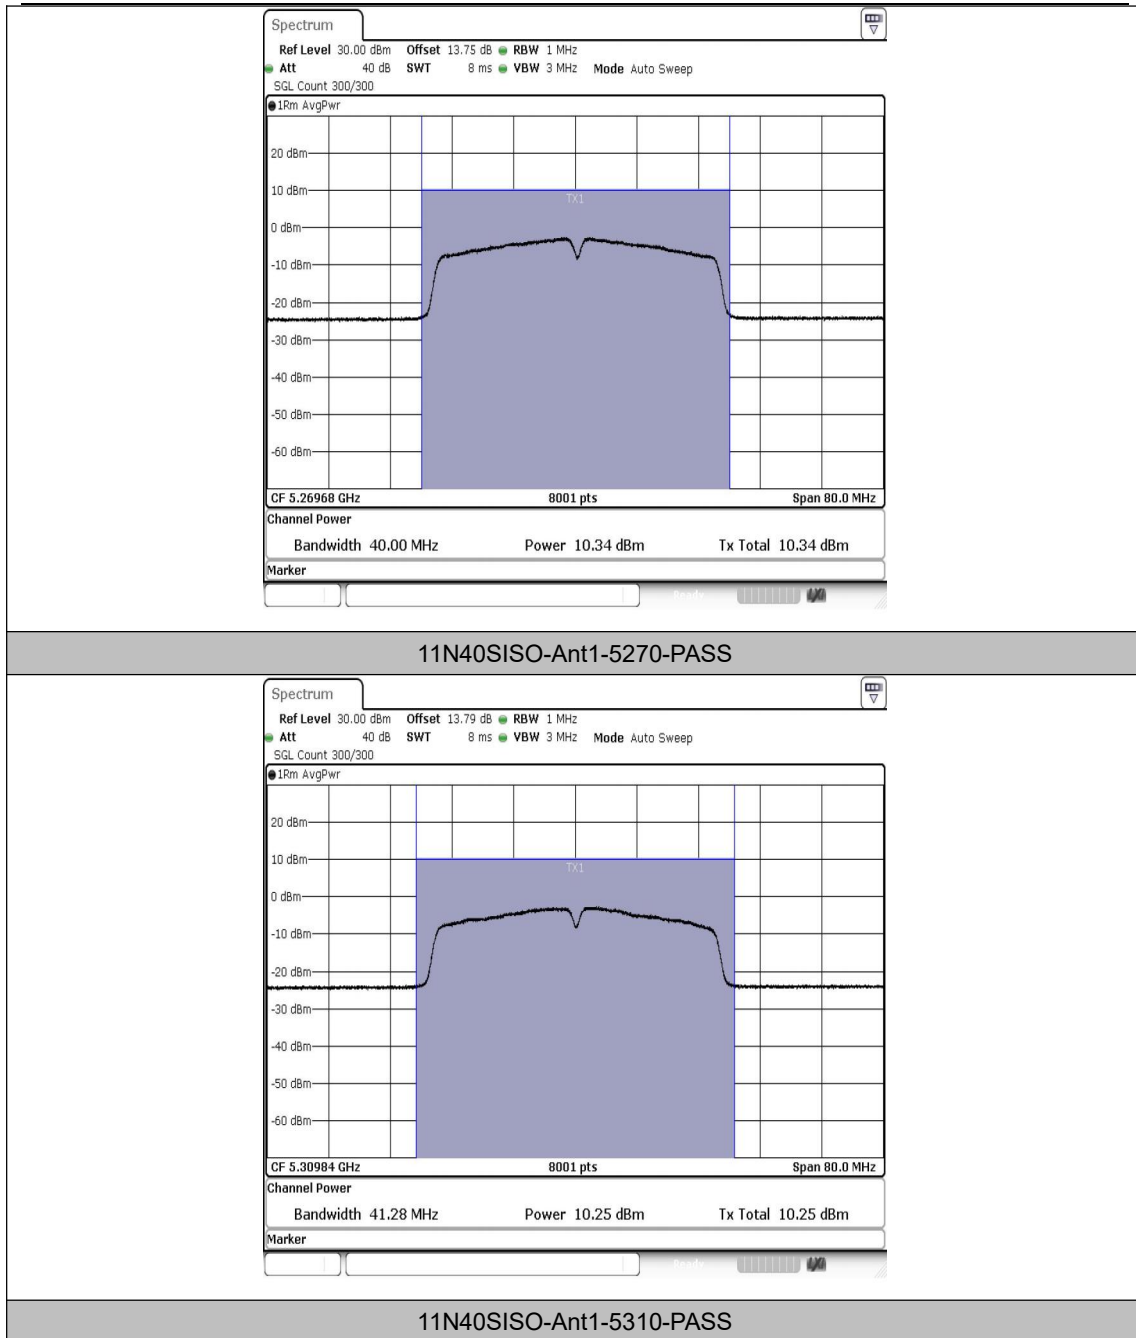


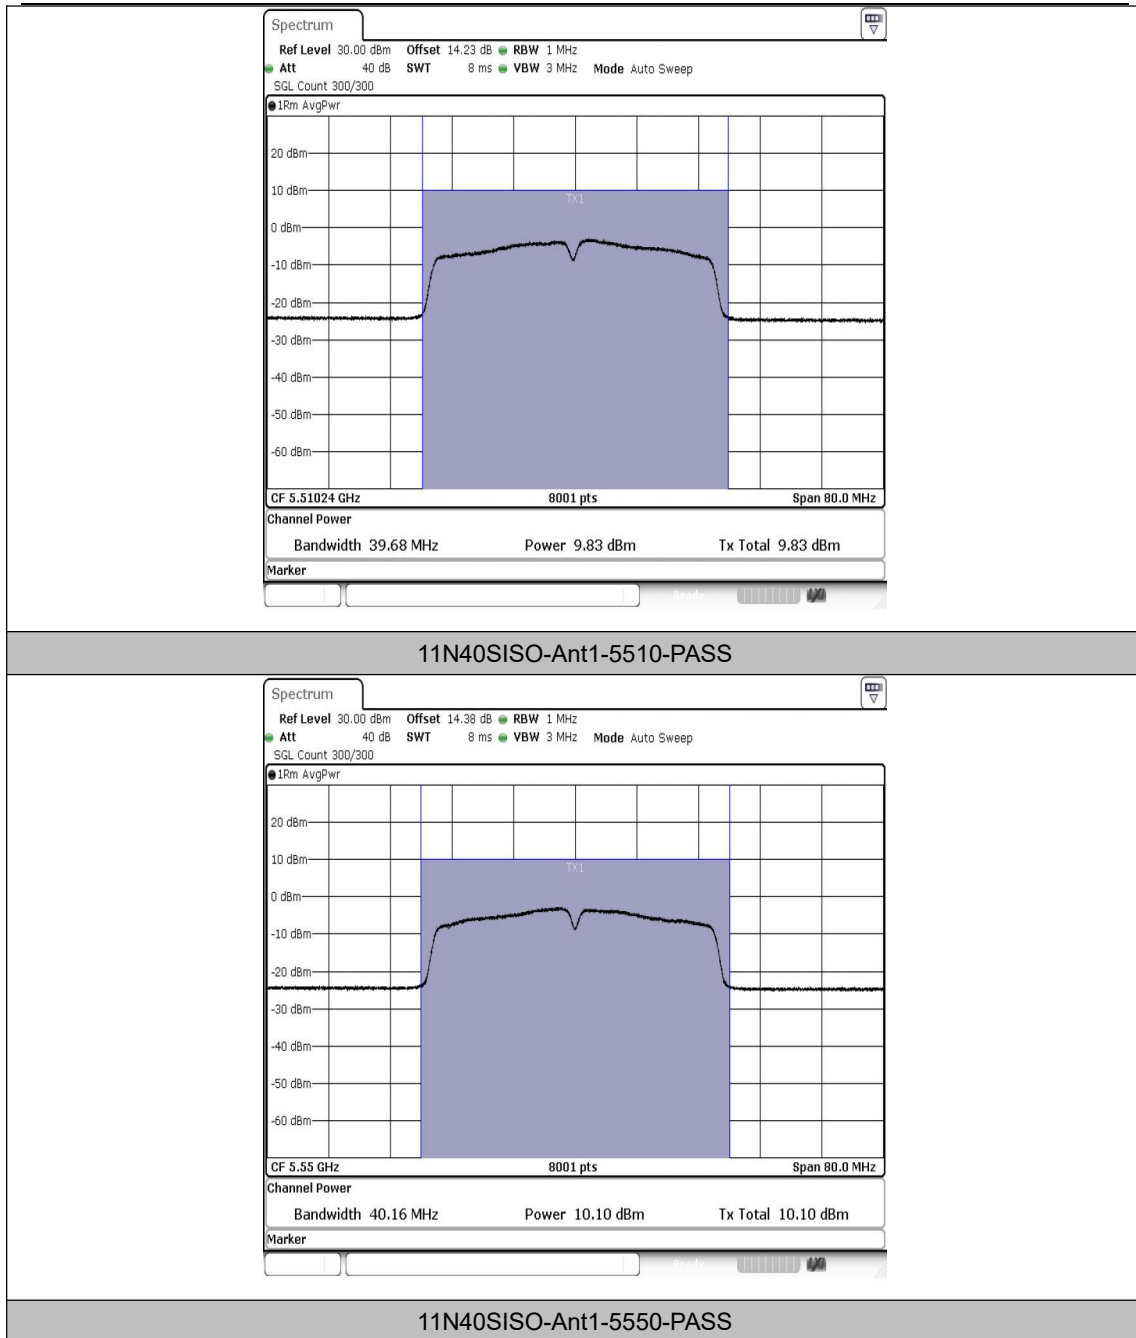


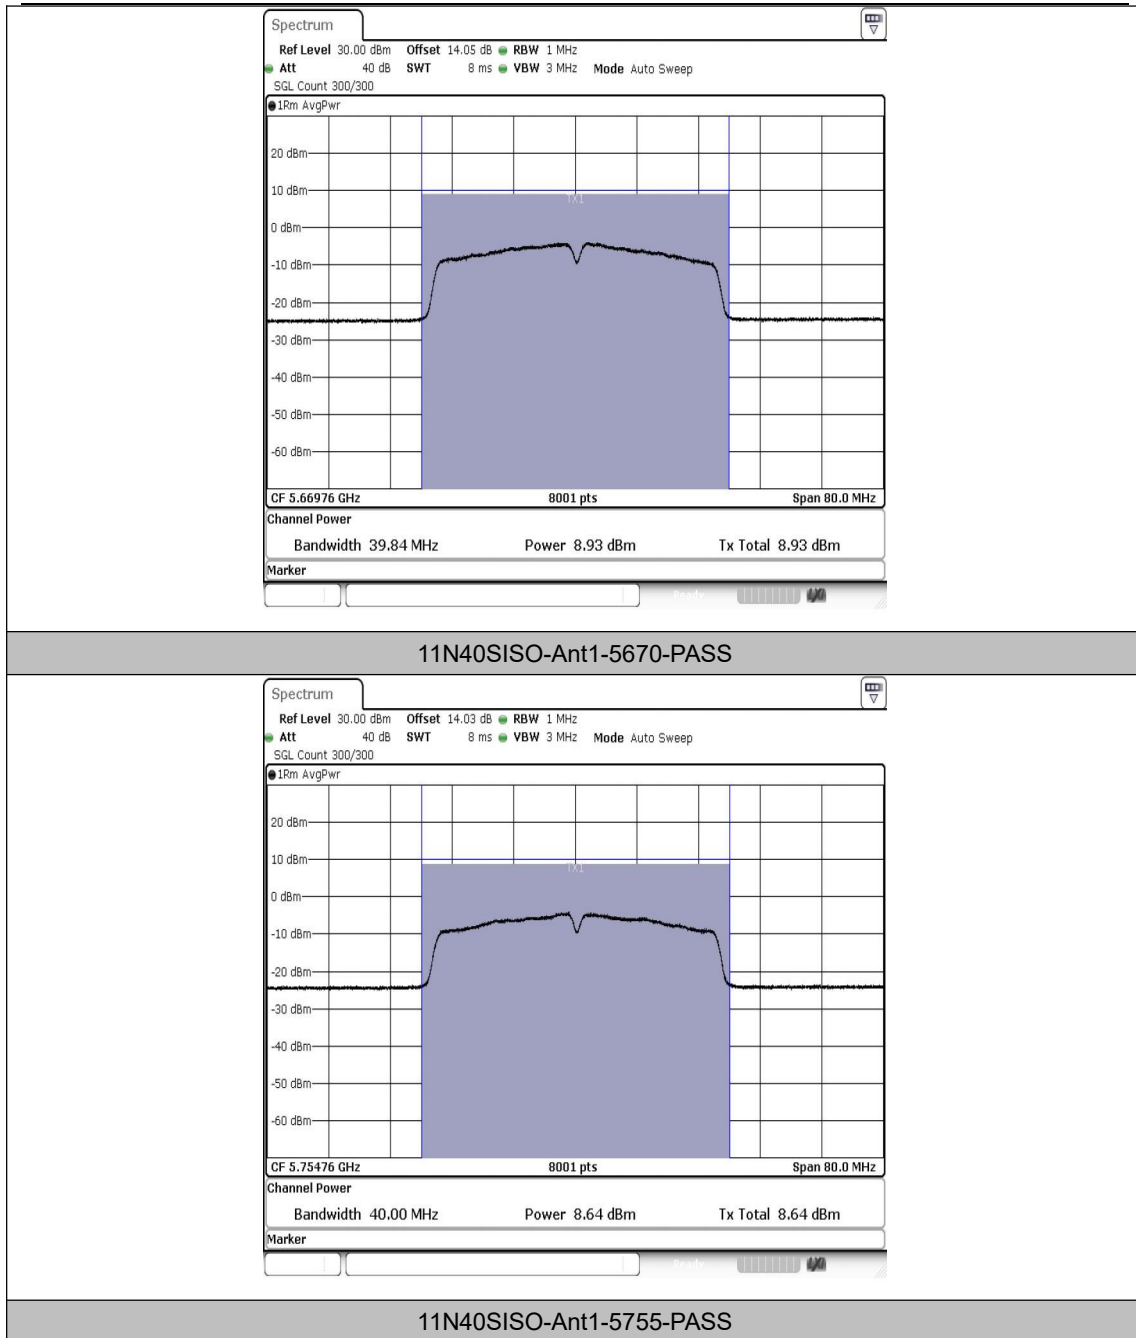


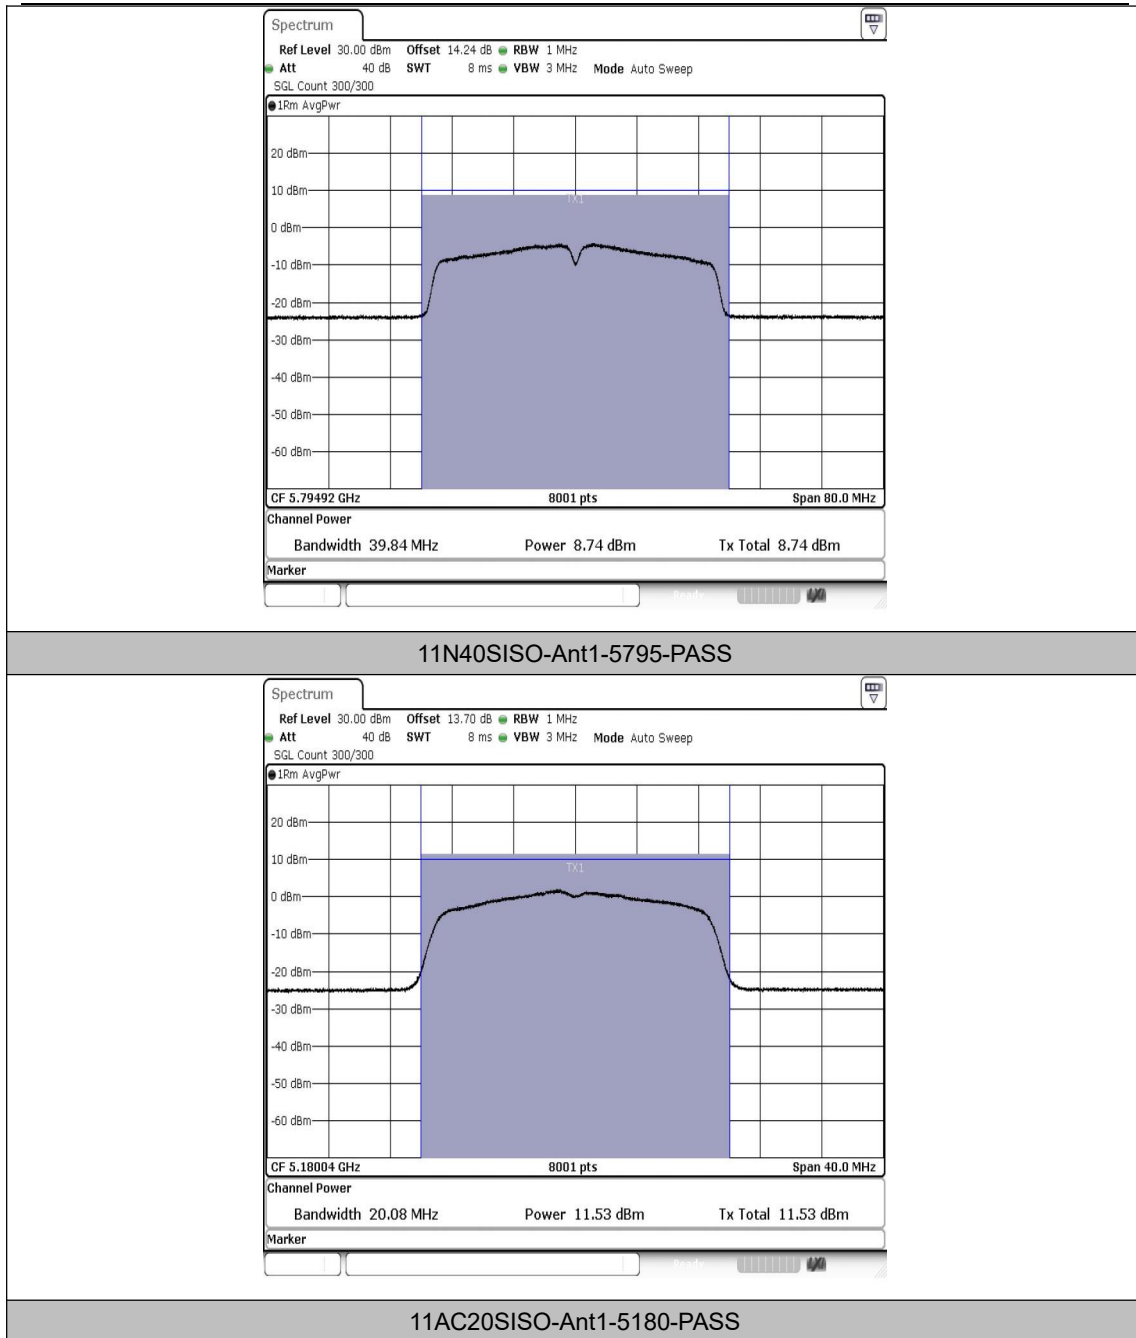


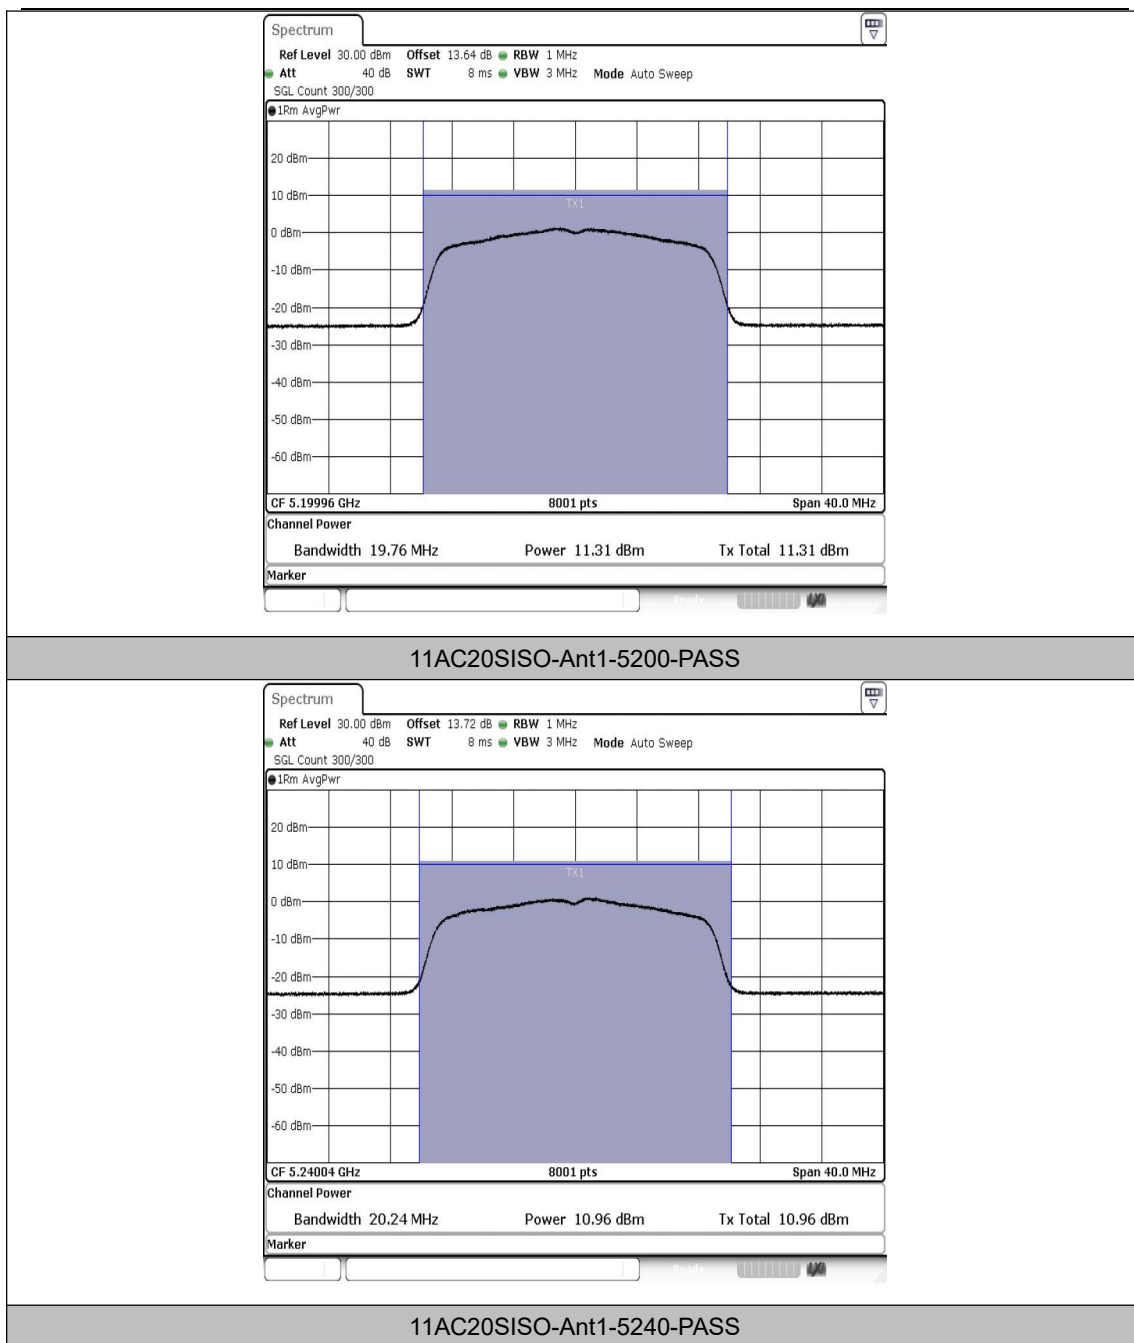


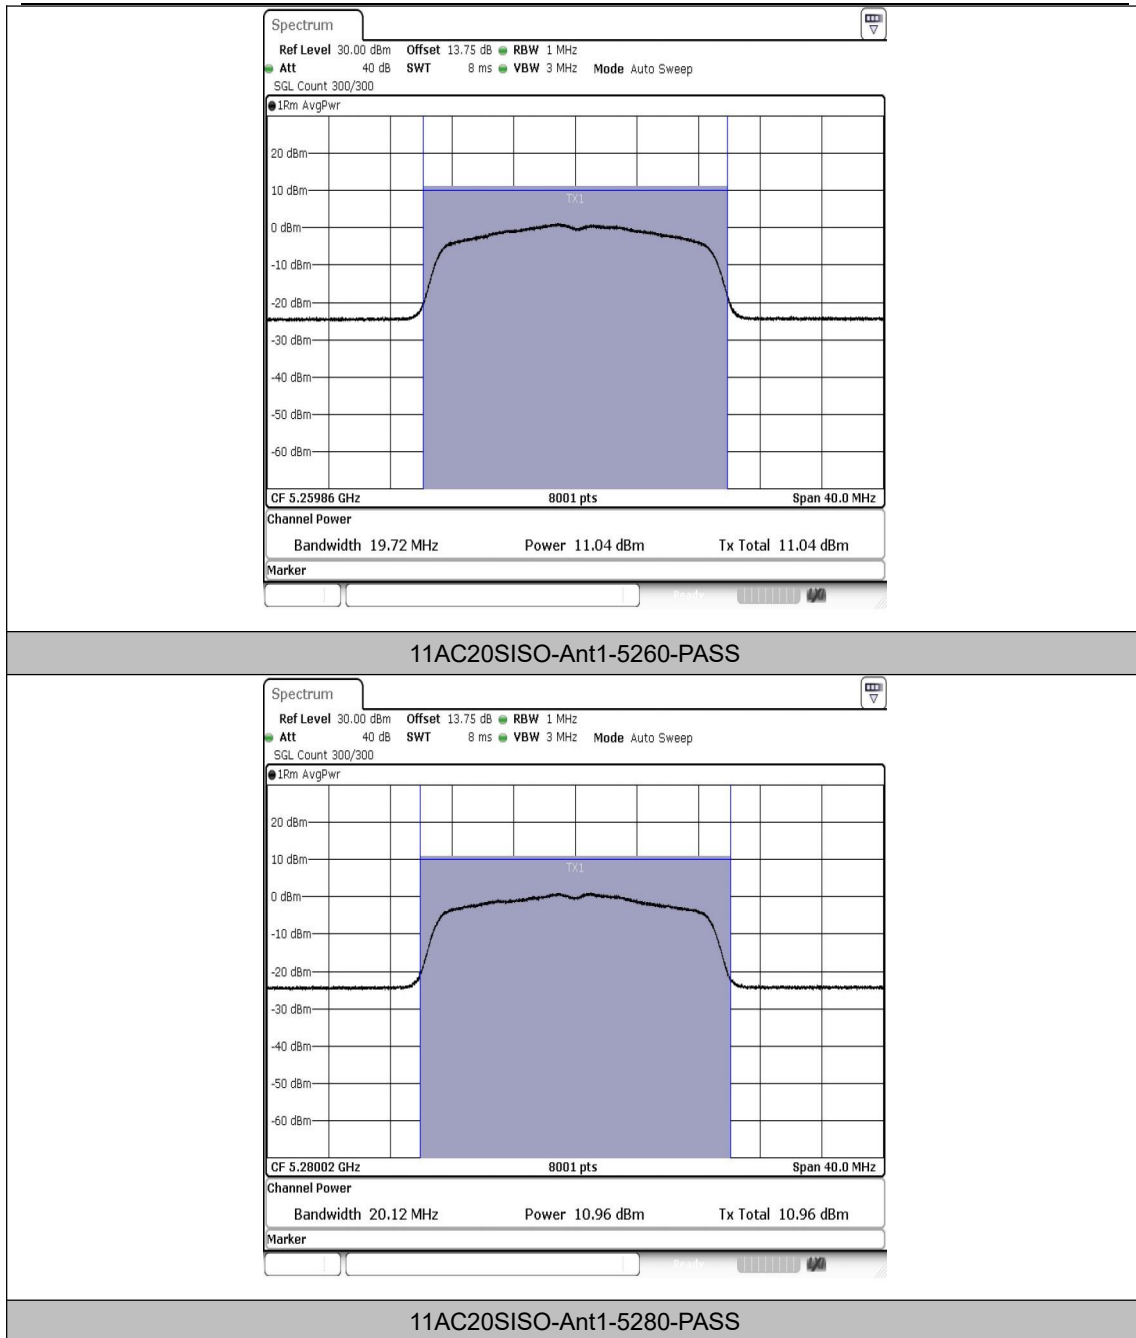


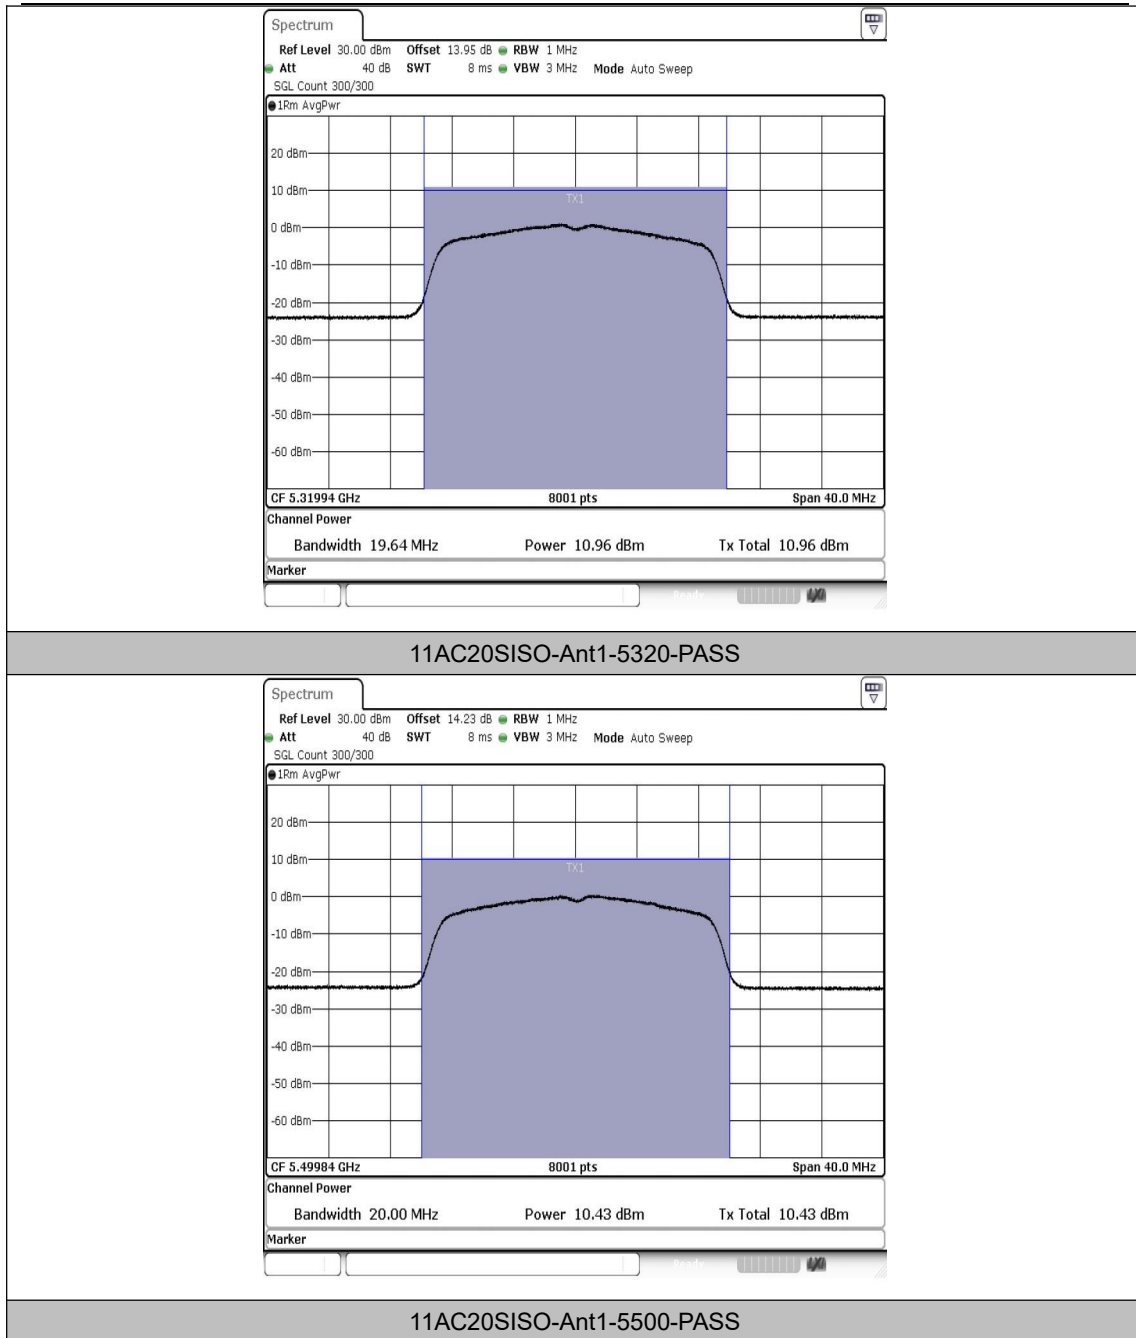

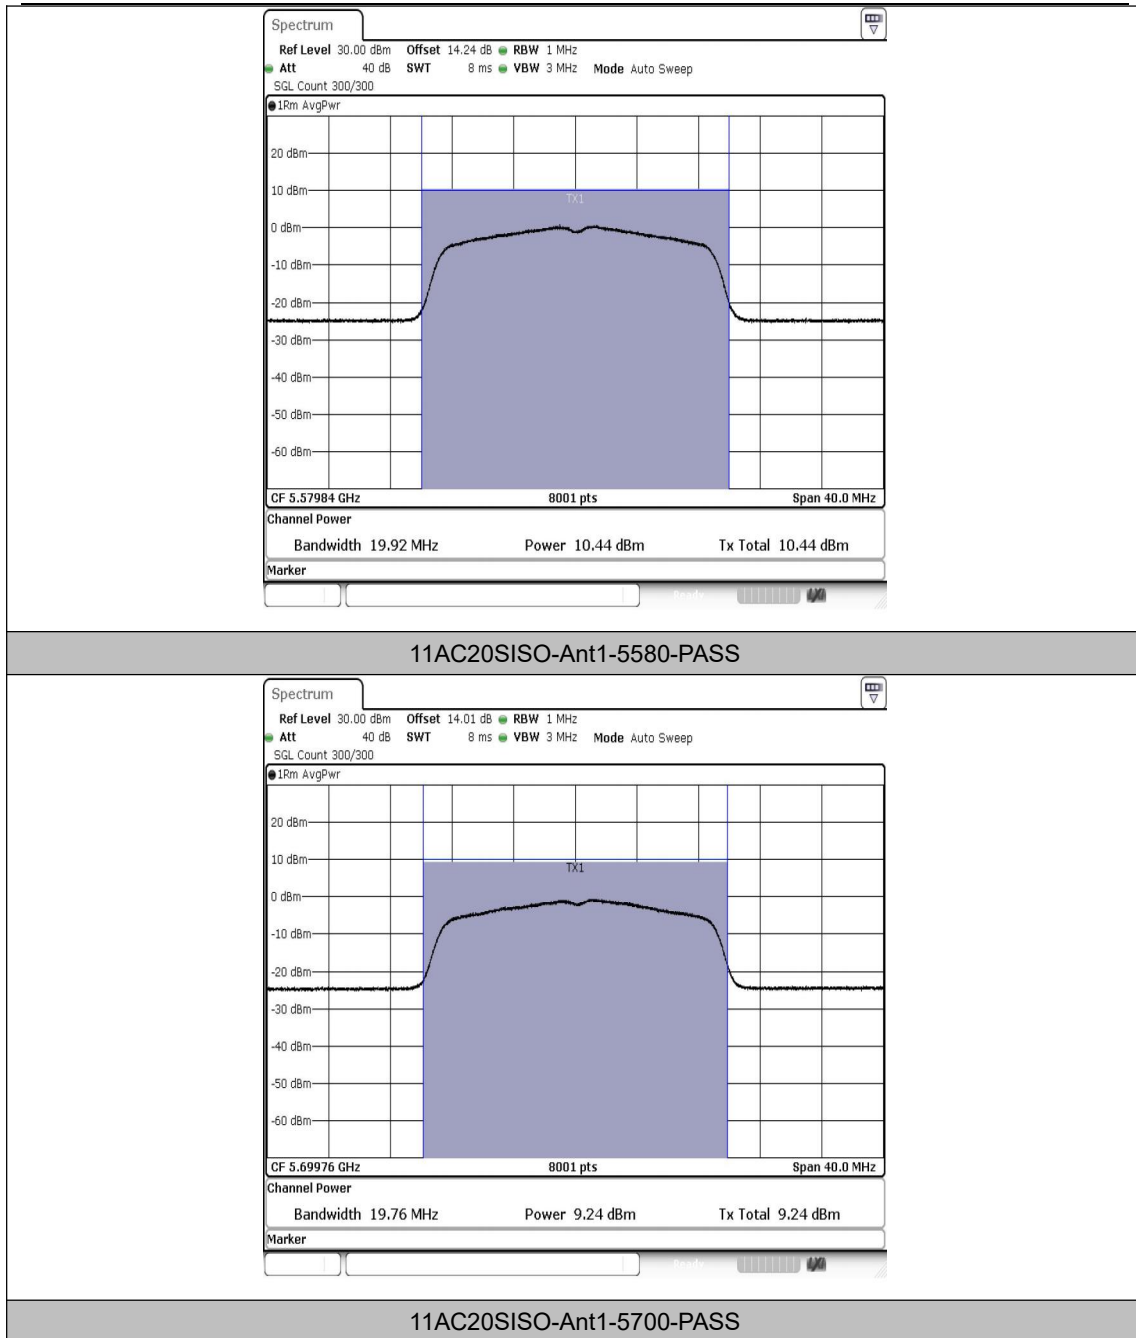

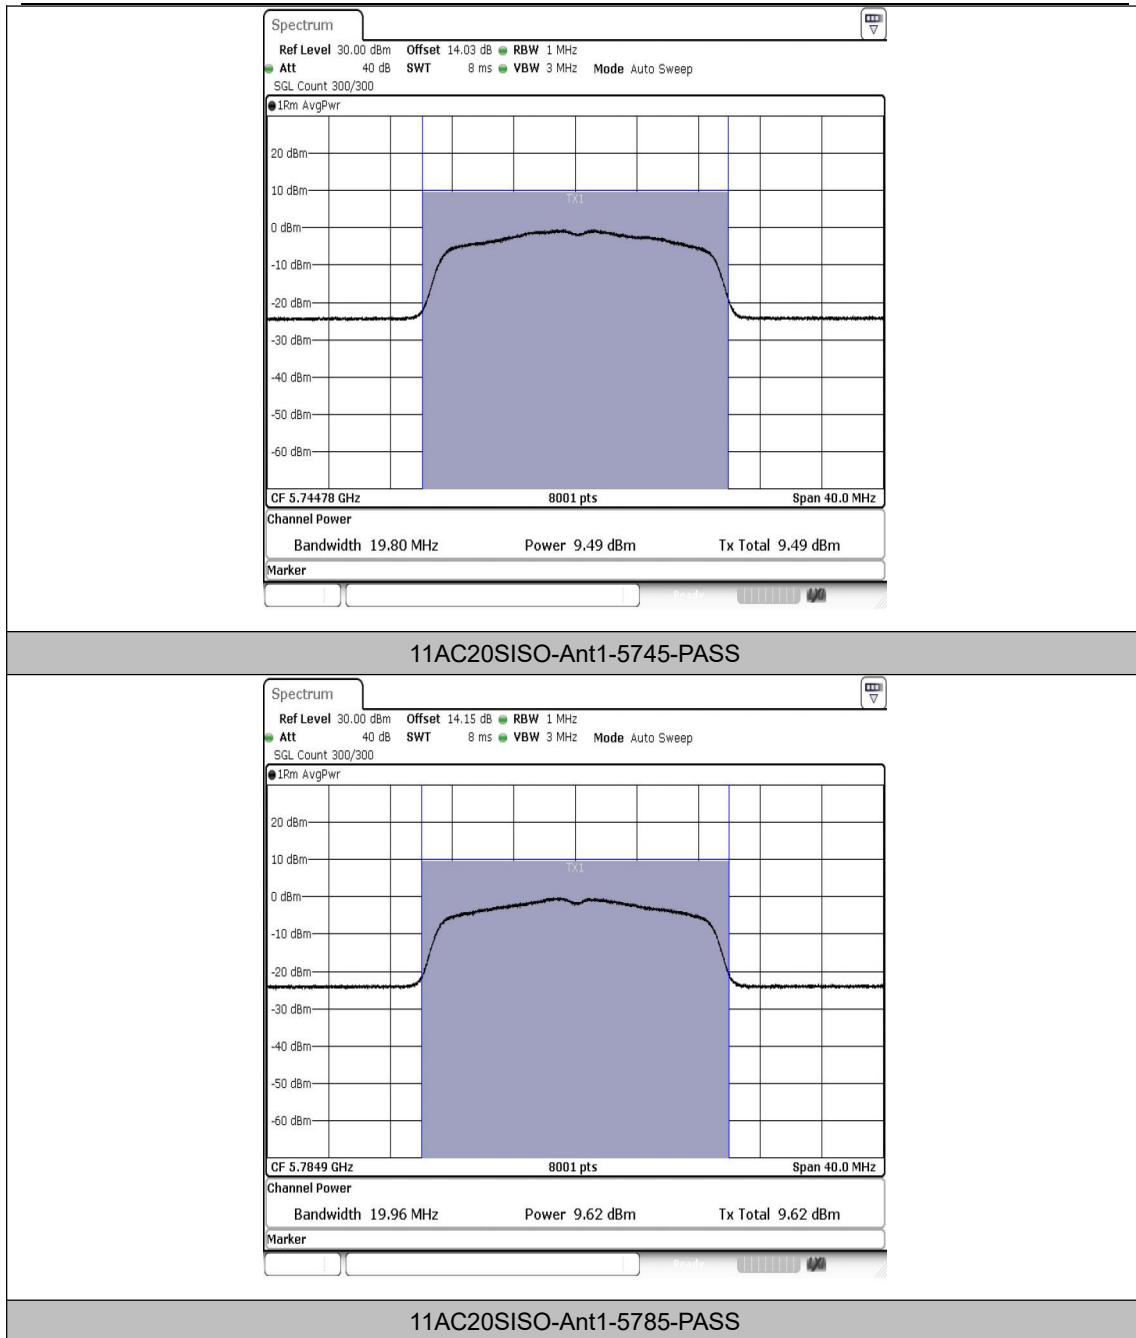

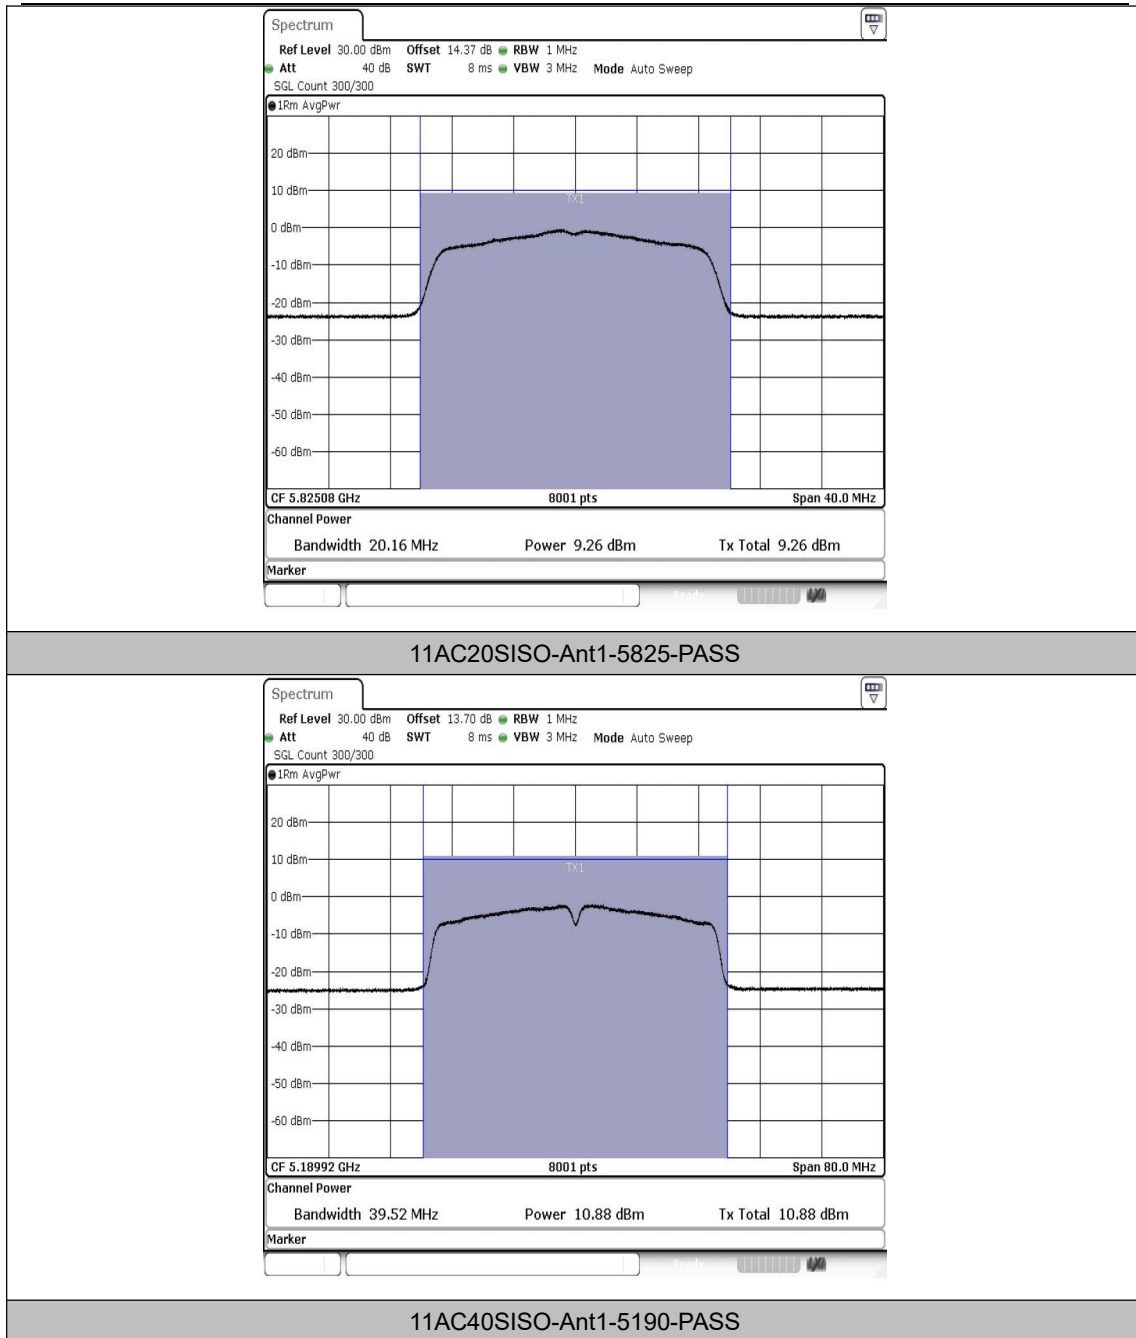

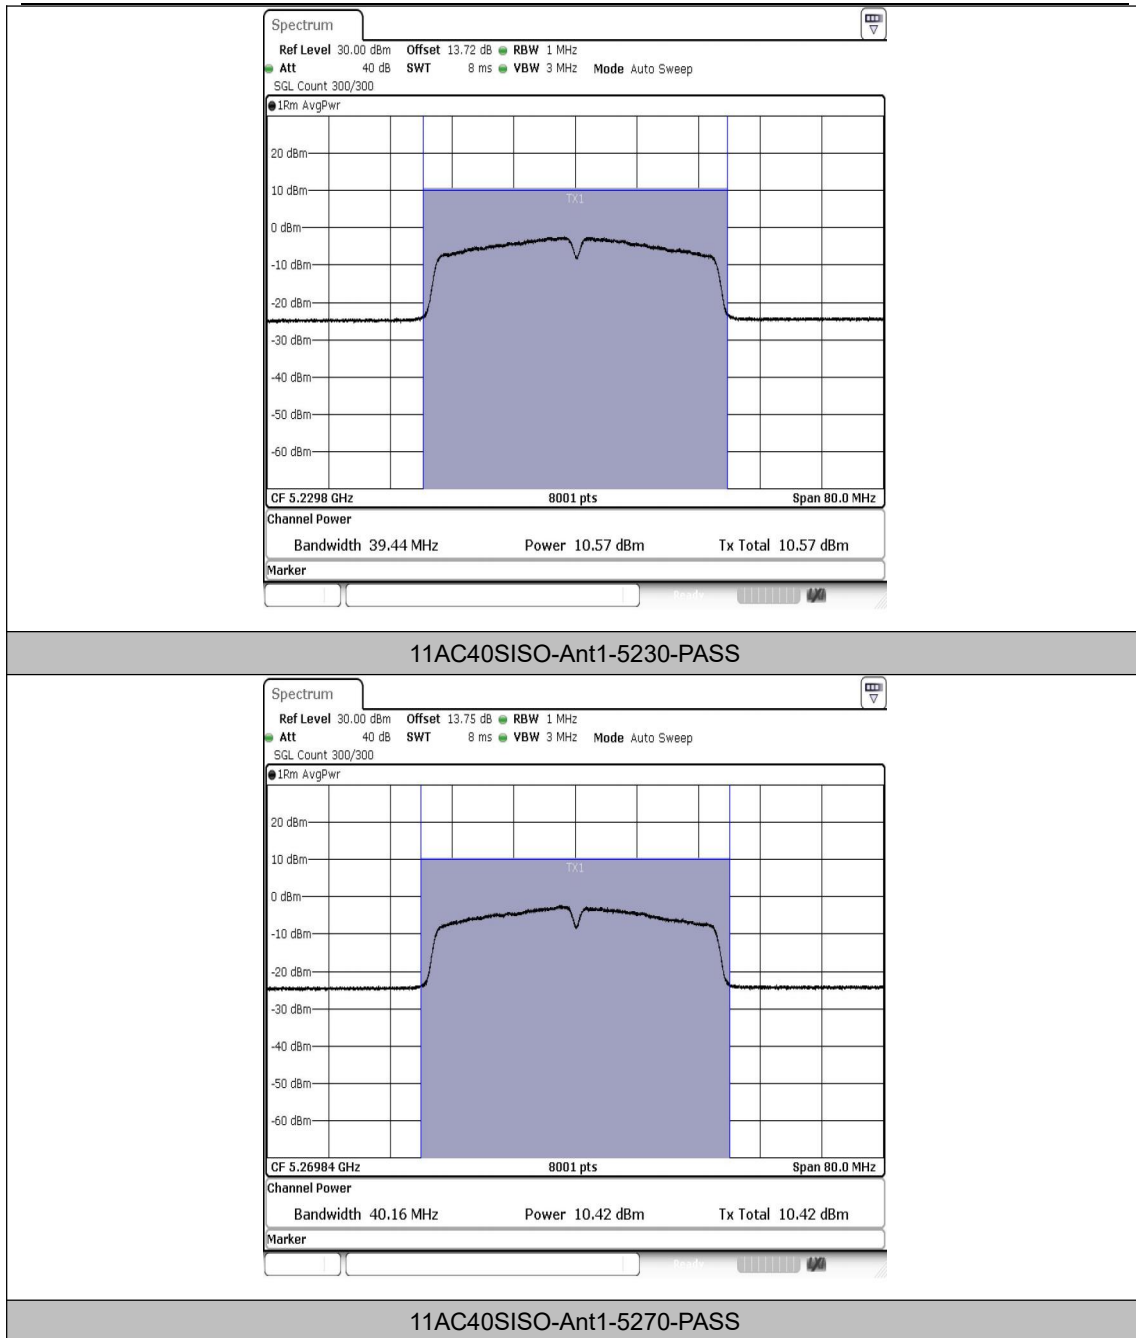


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com





Hotline
400-003-0500
www.anbotek.com




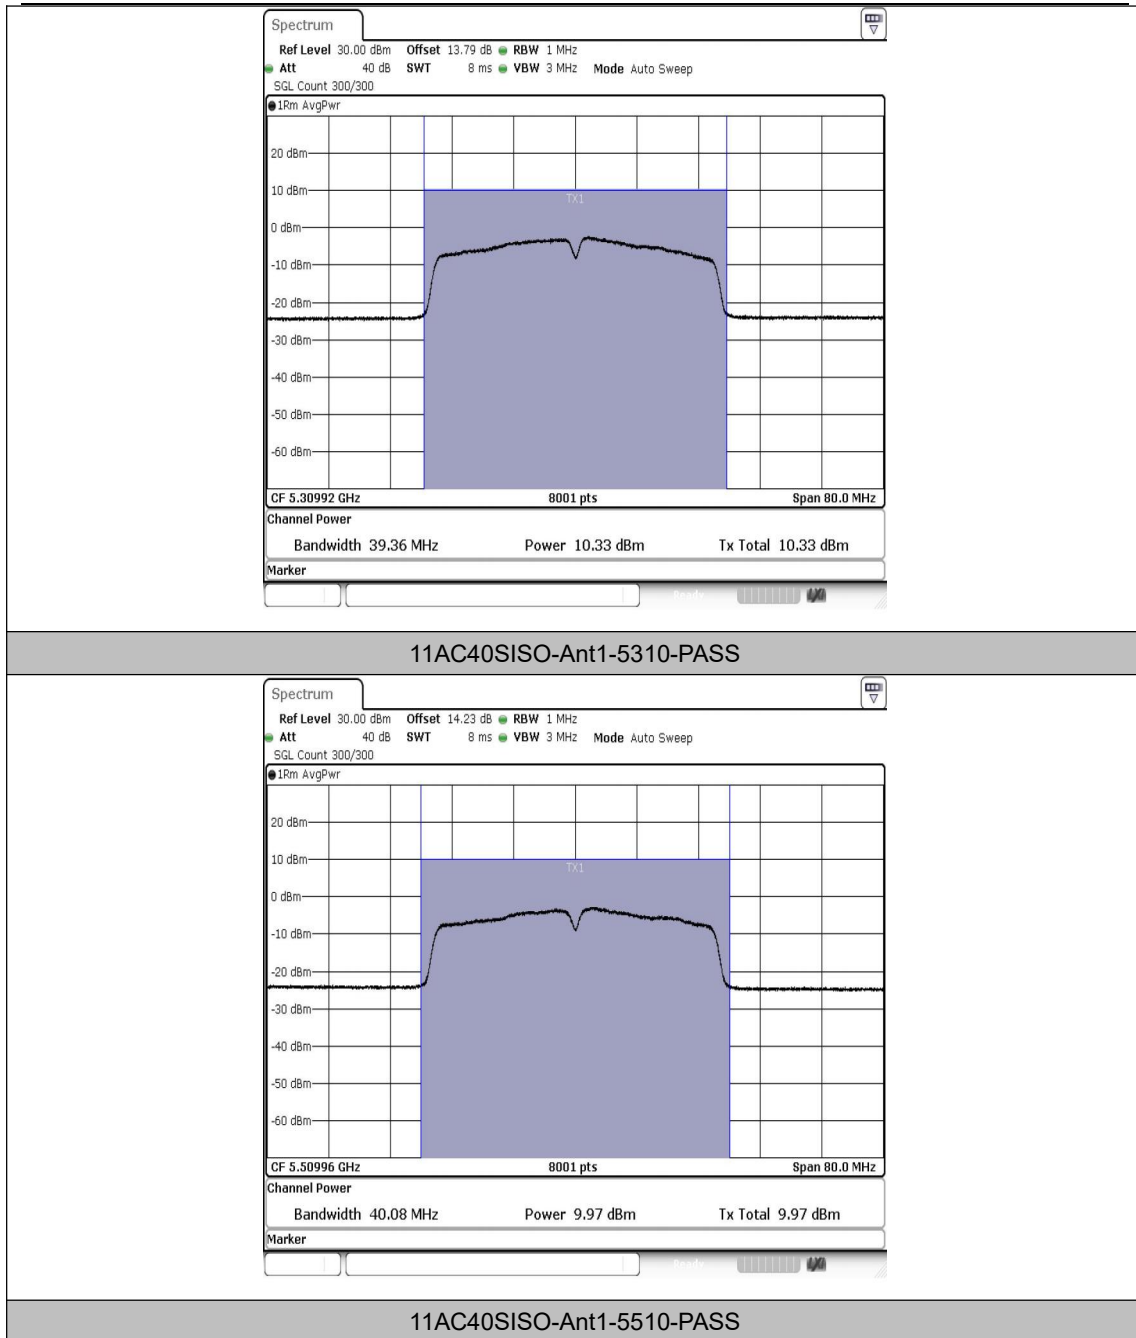


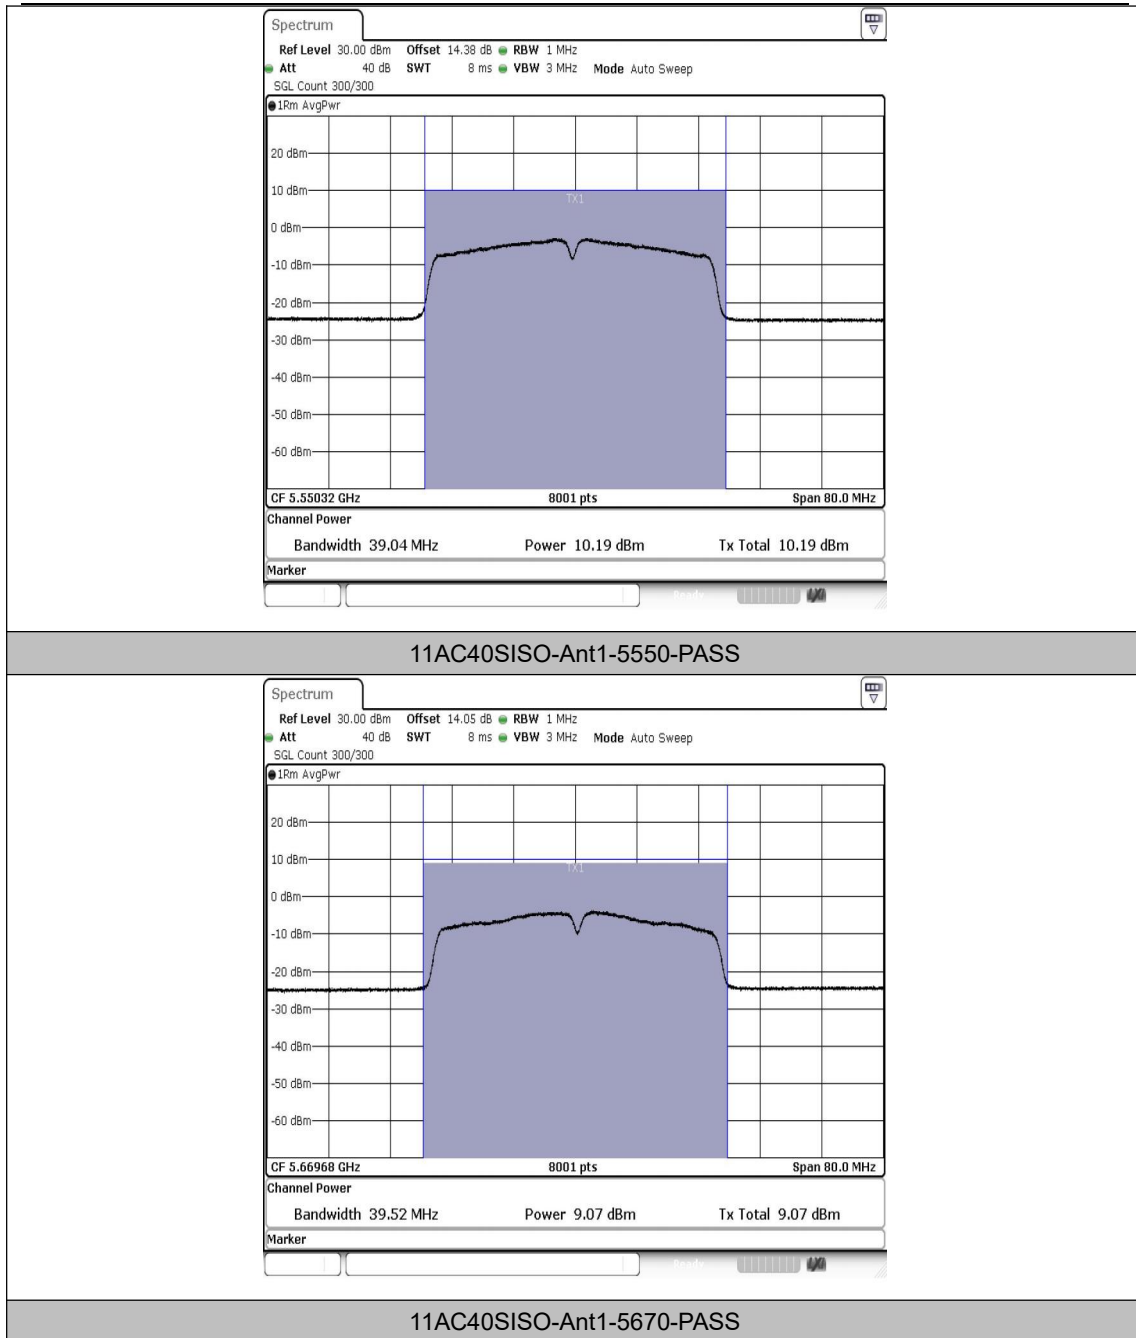


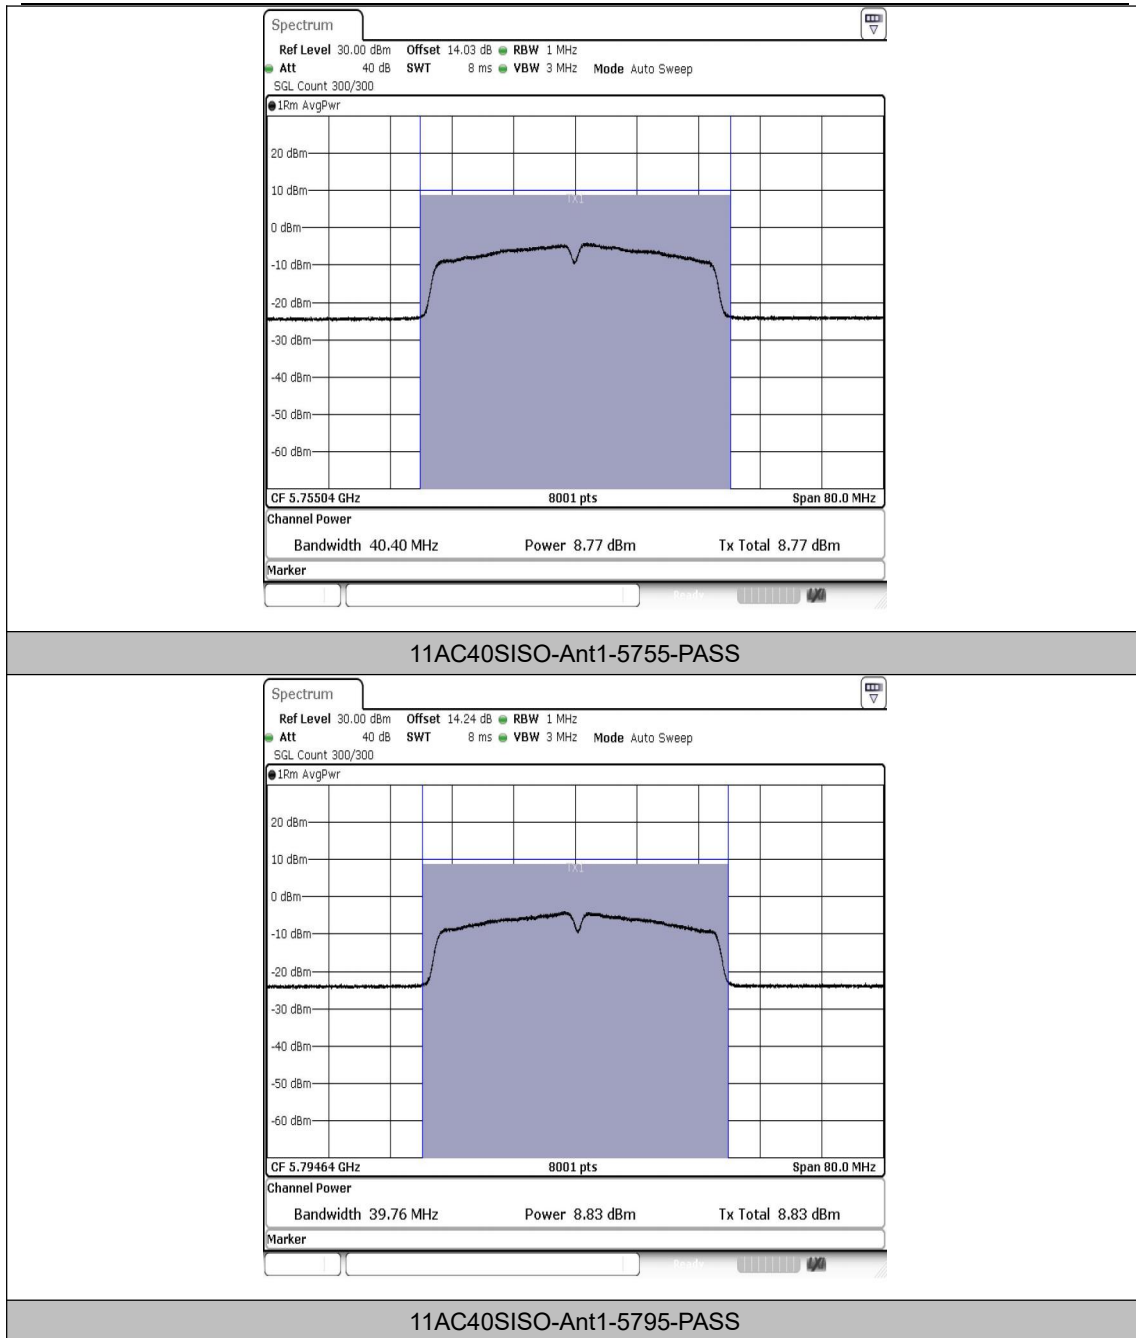


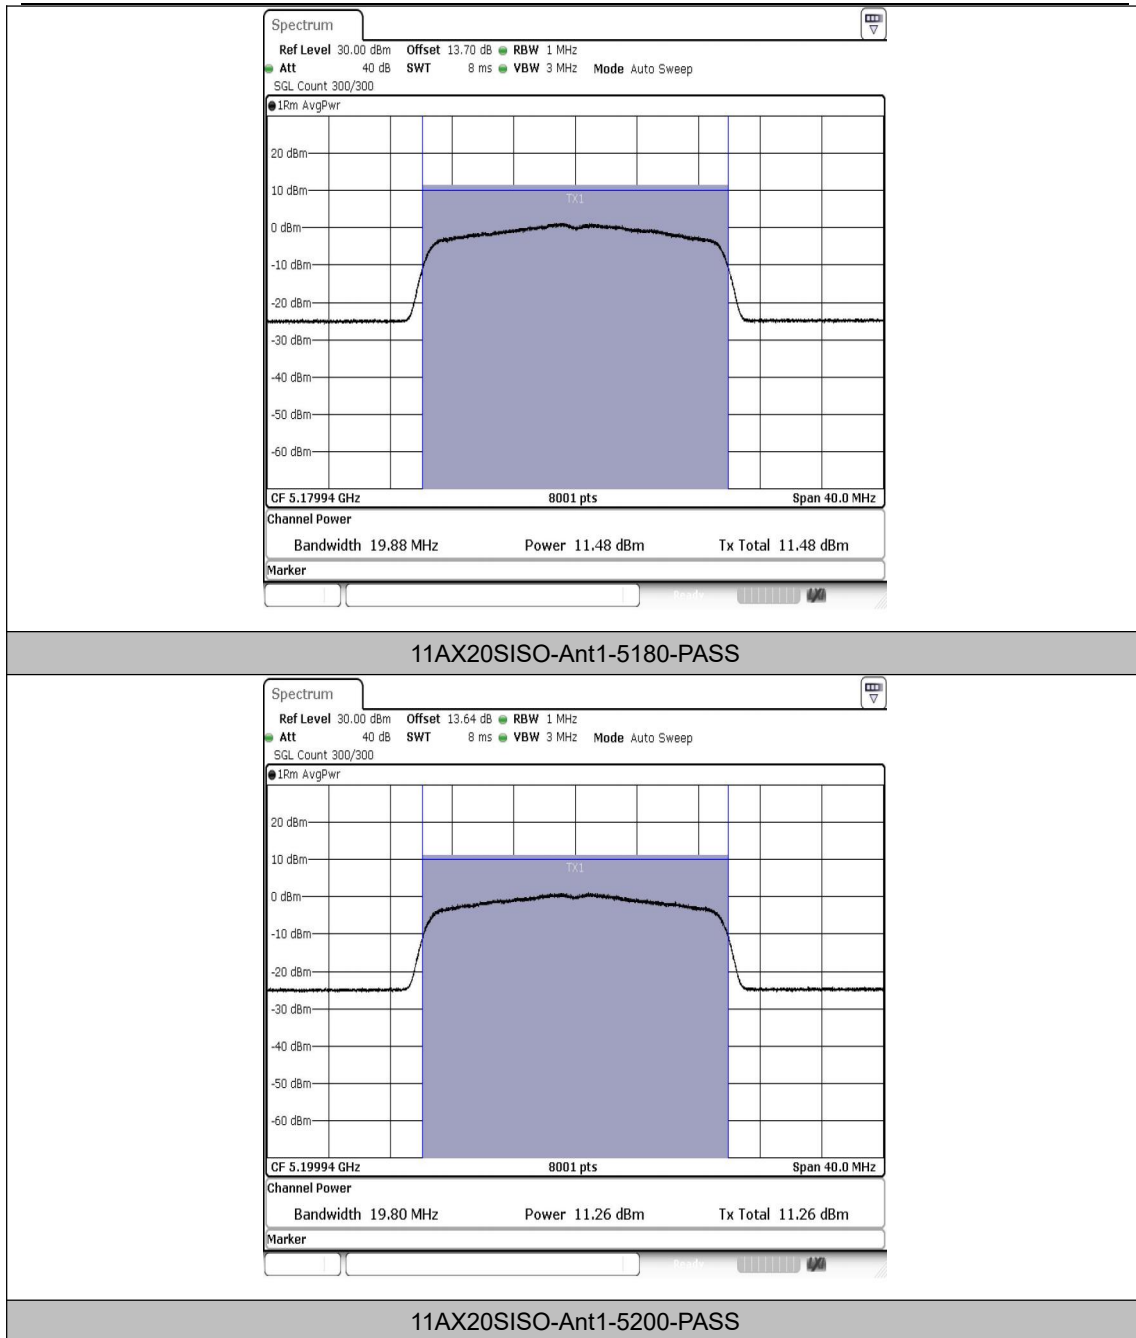


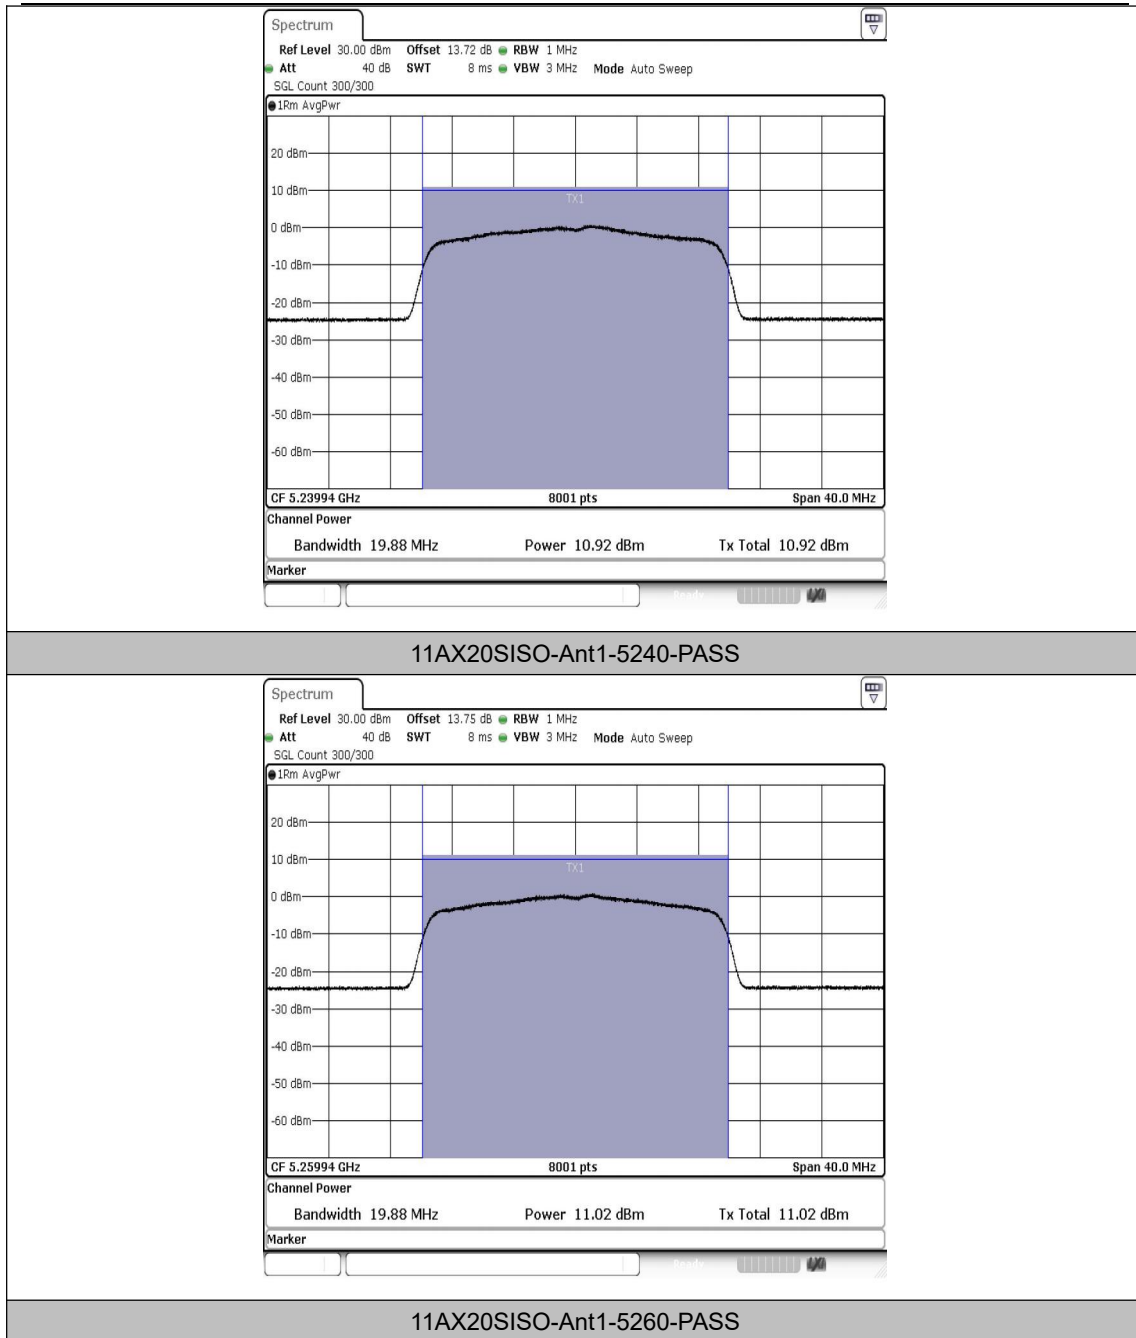


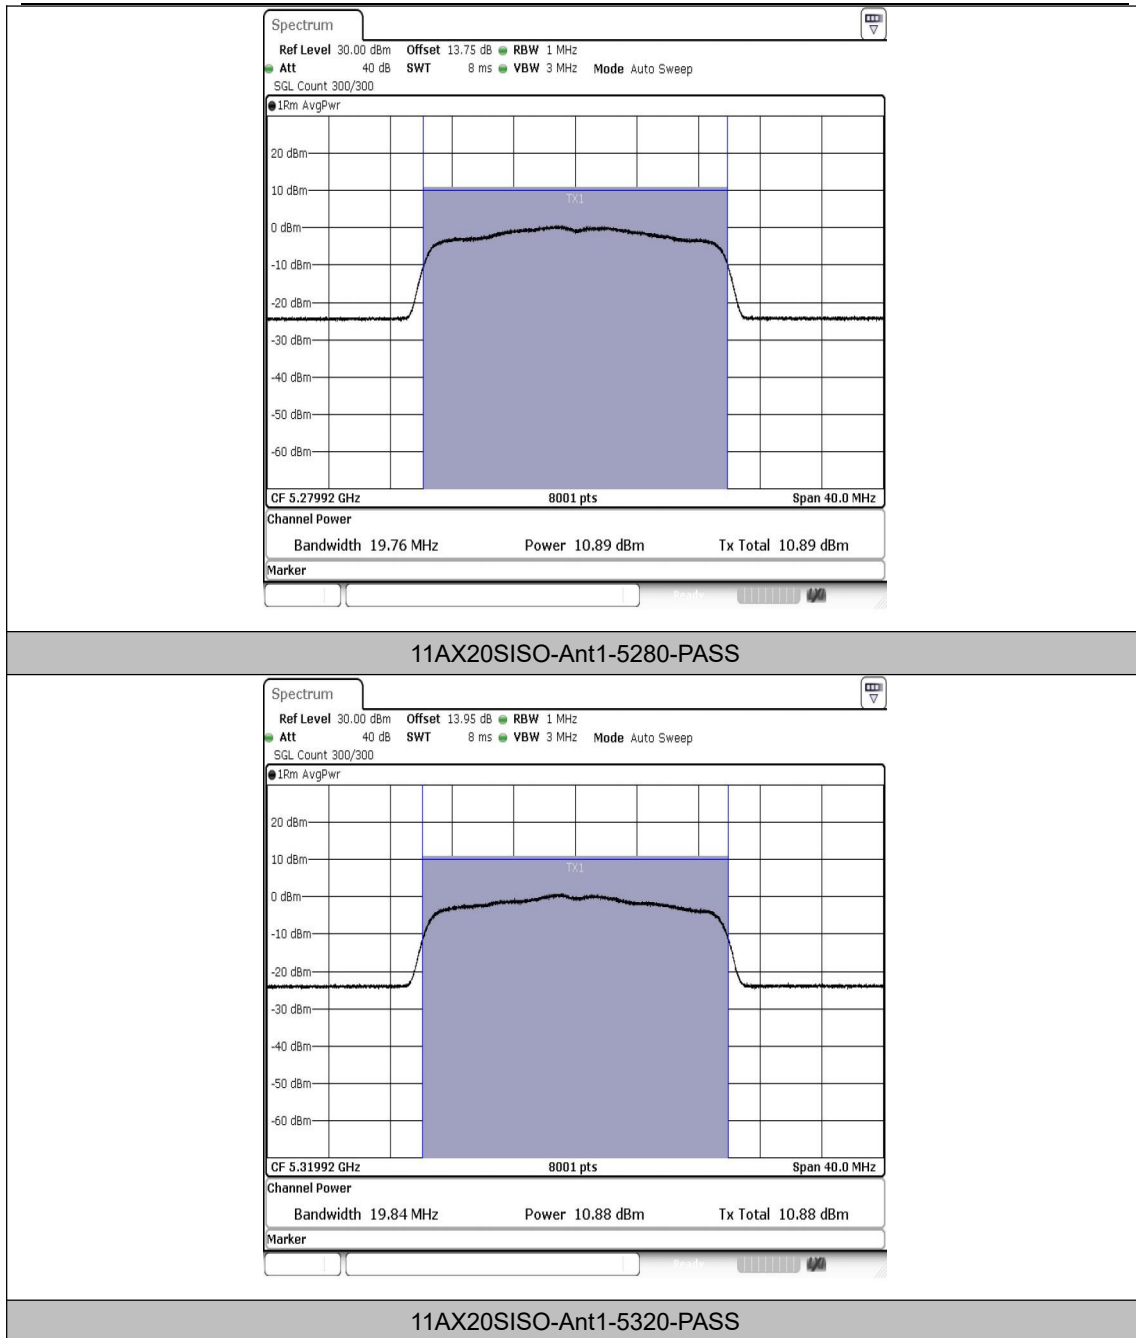


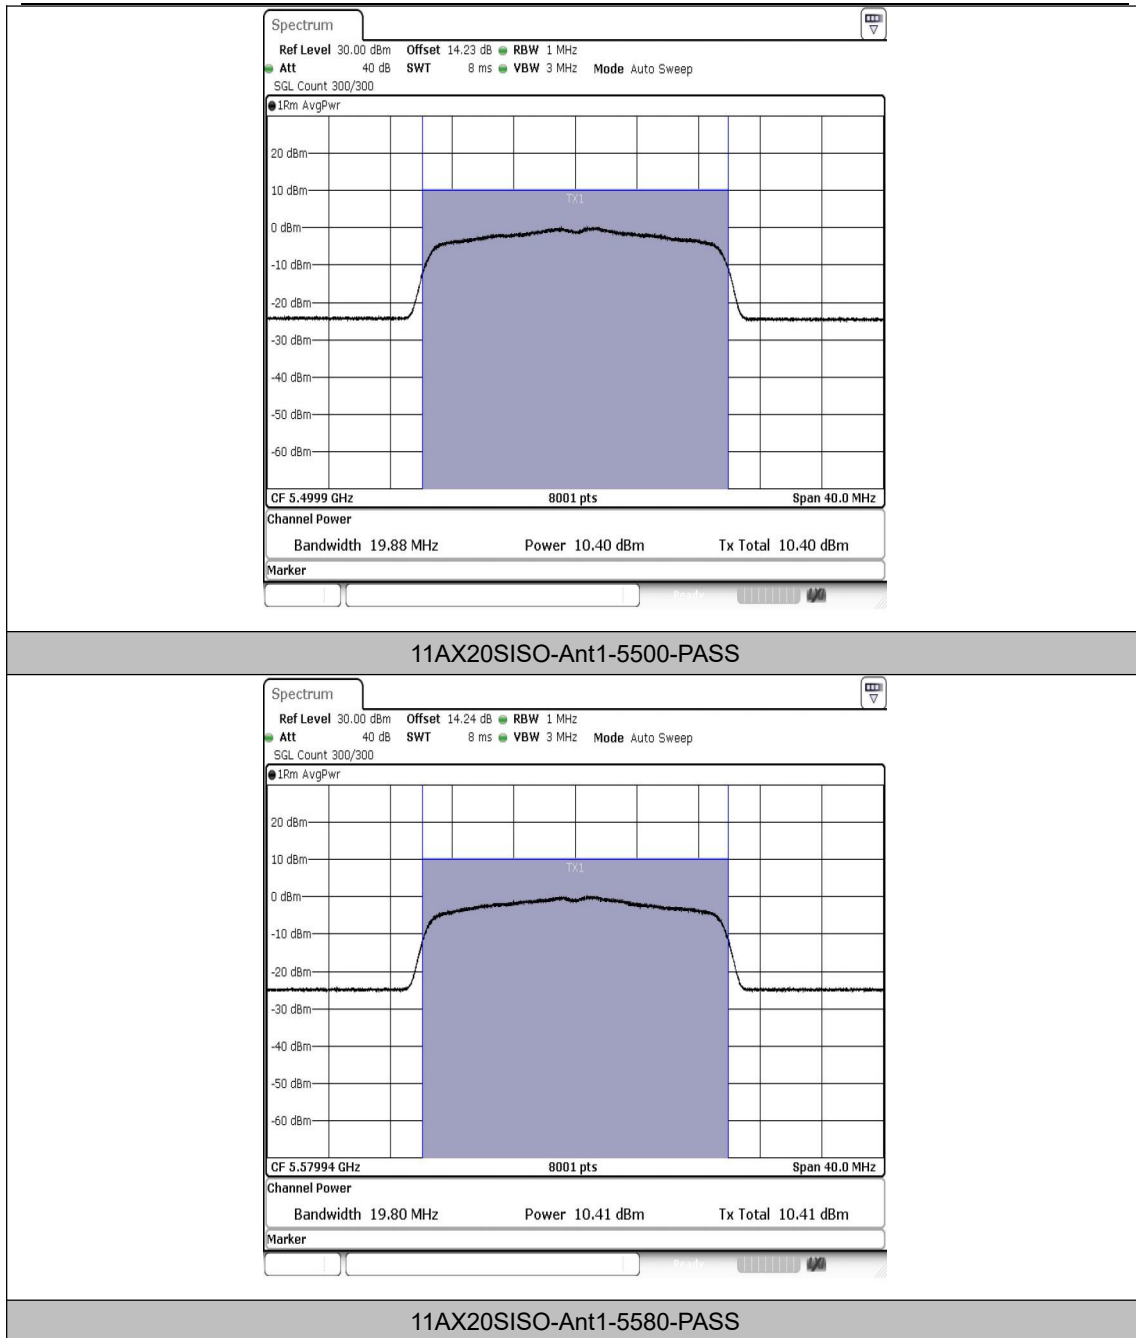


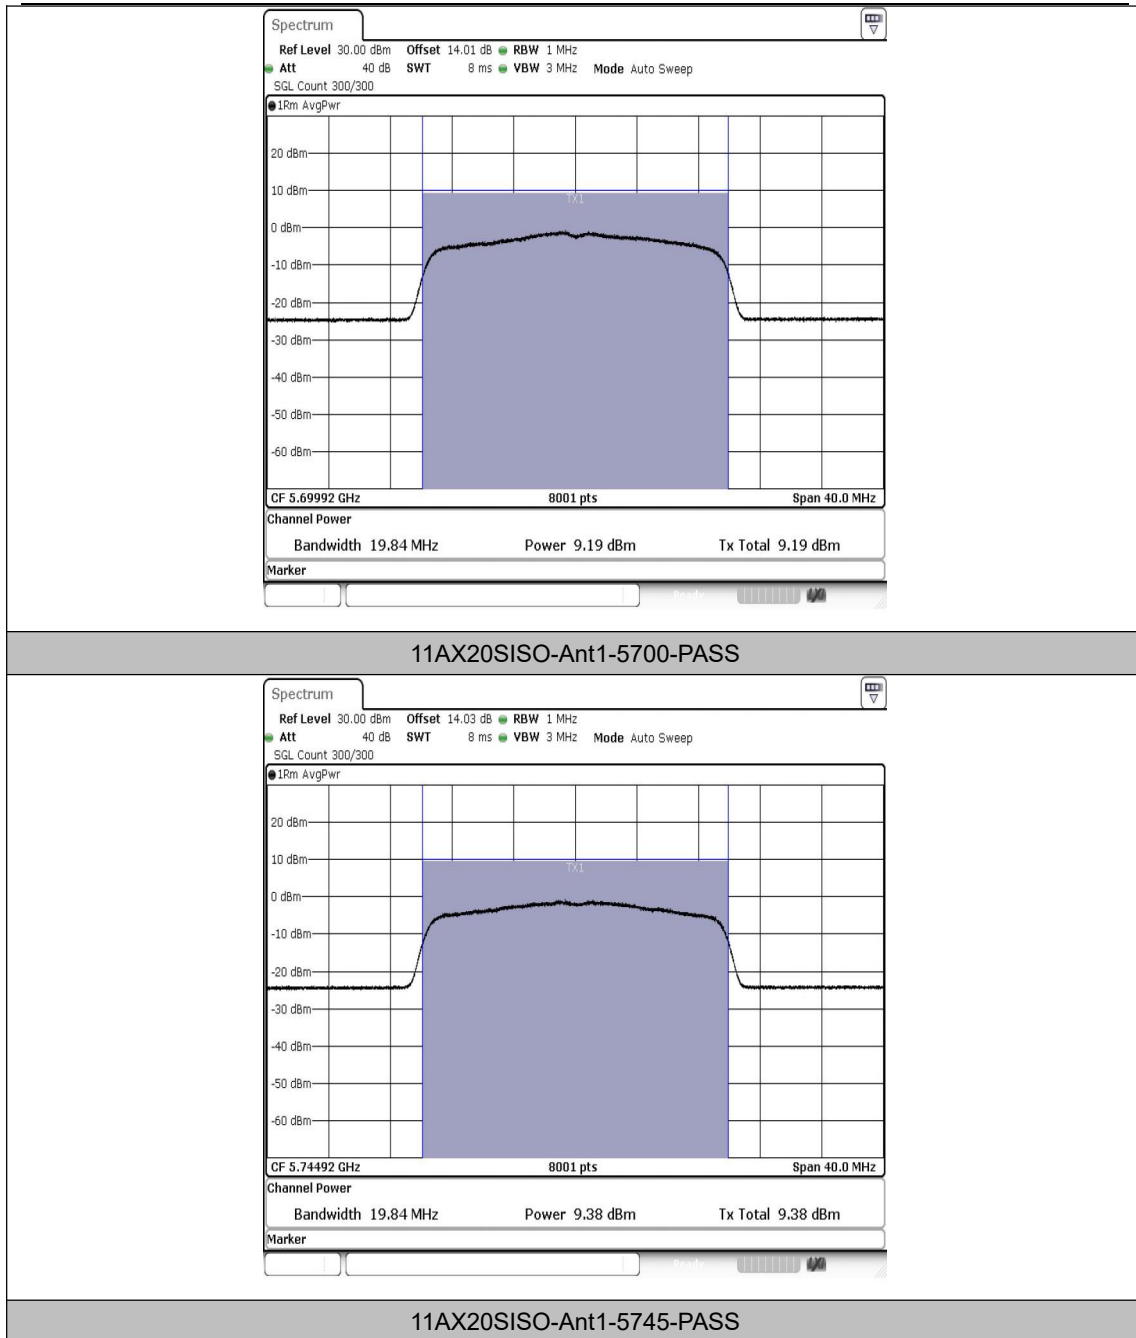

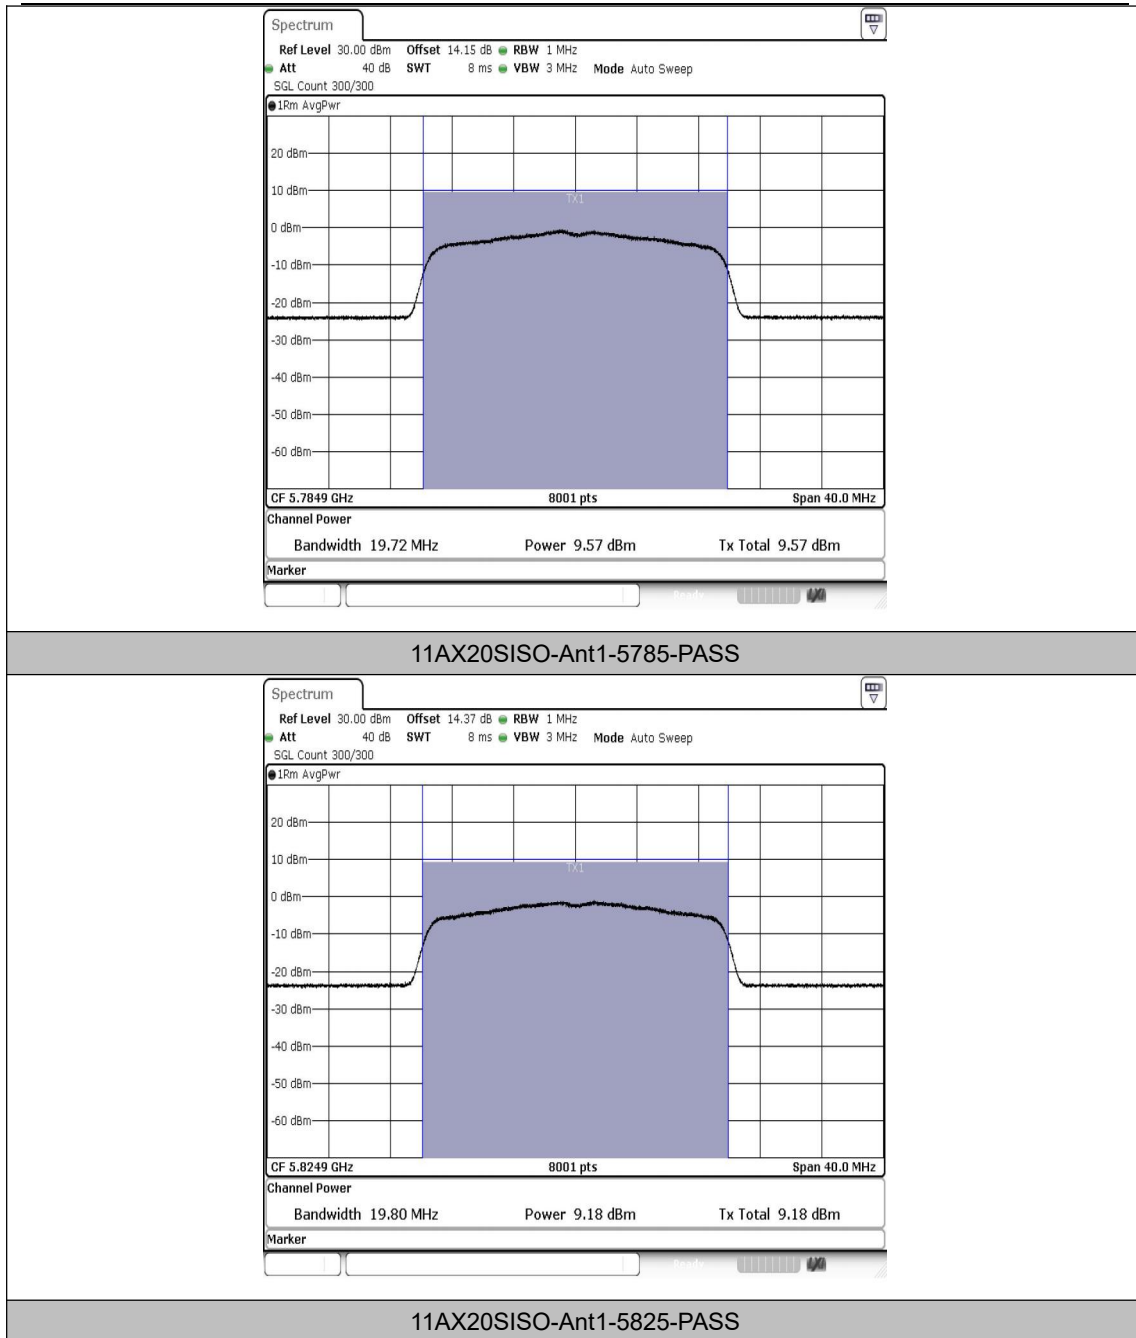

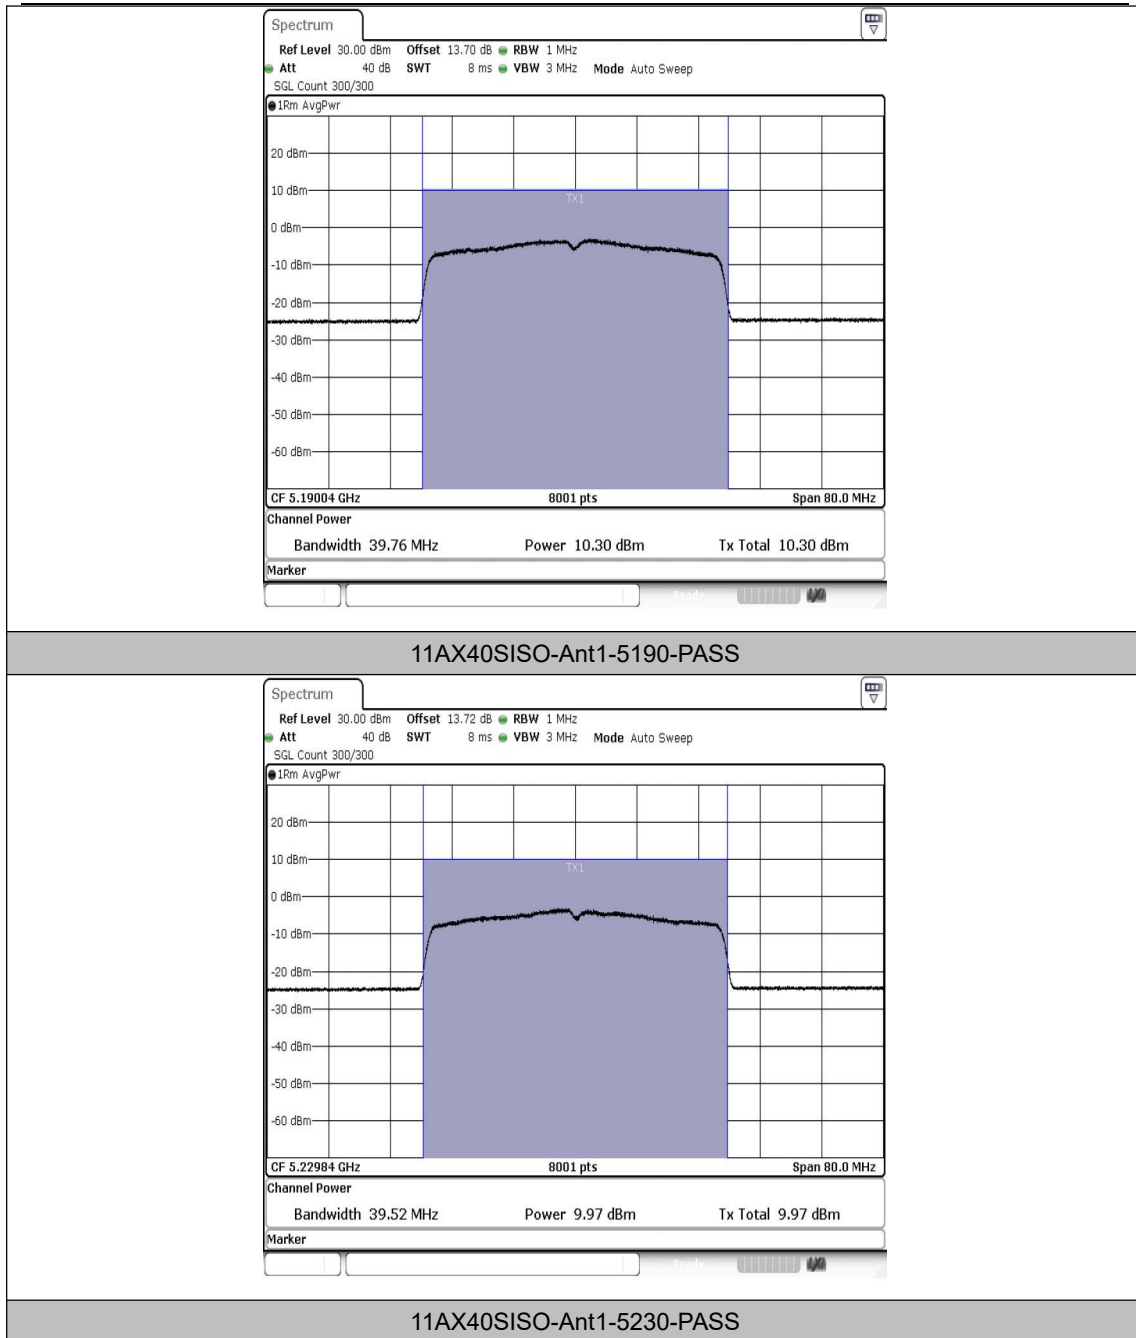

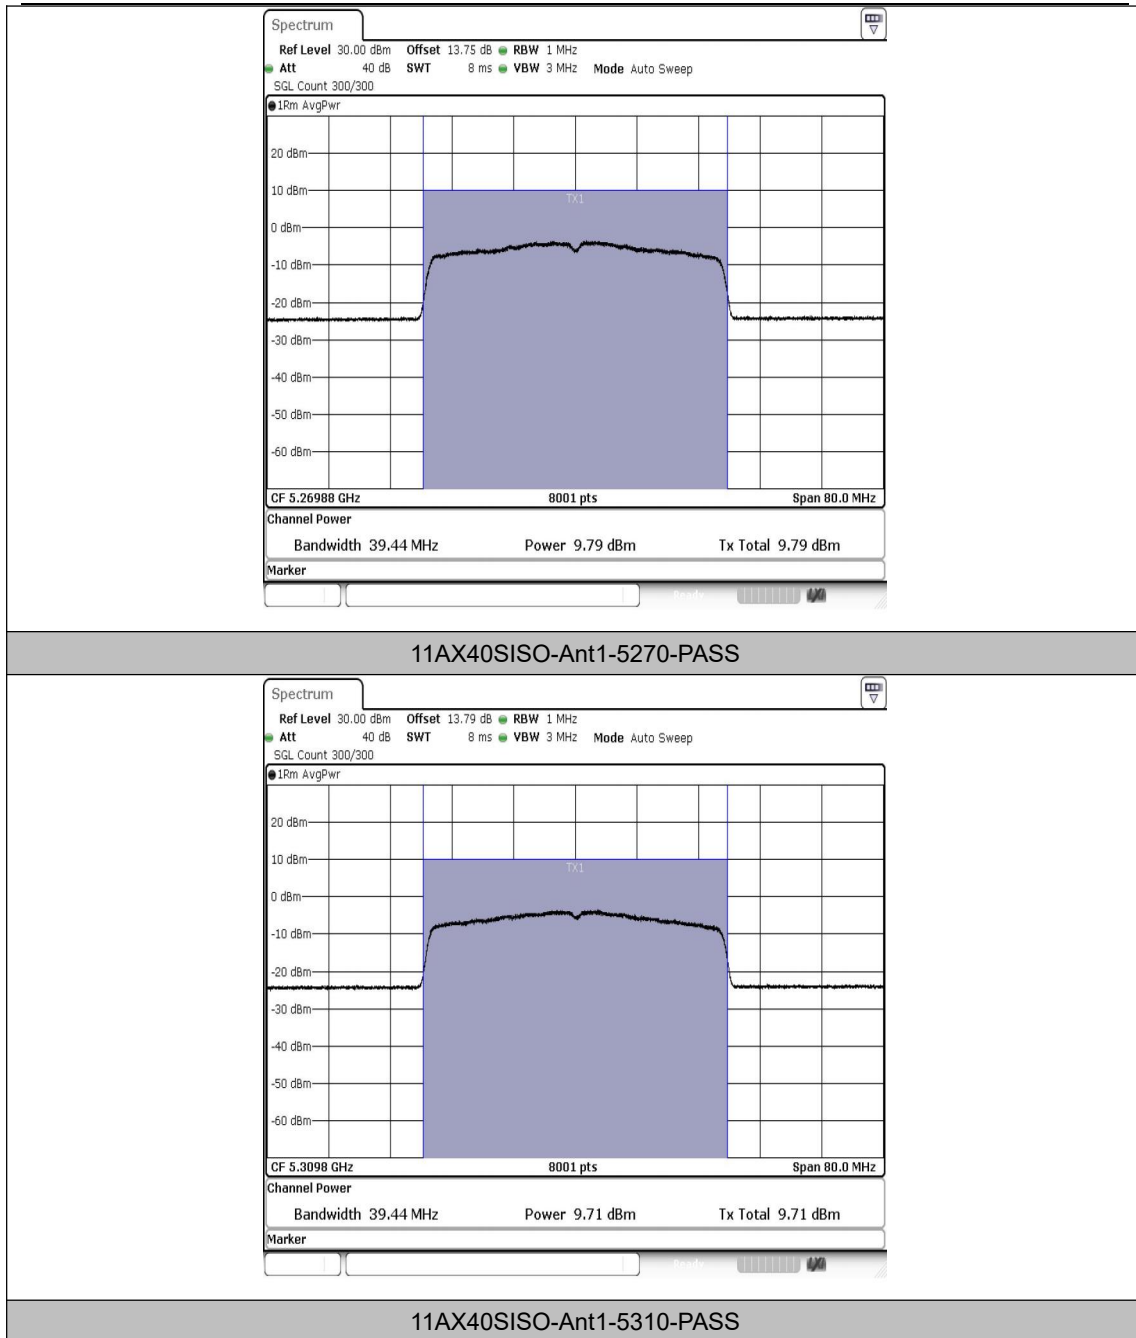

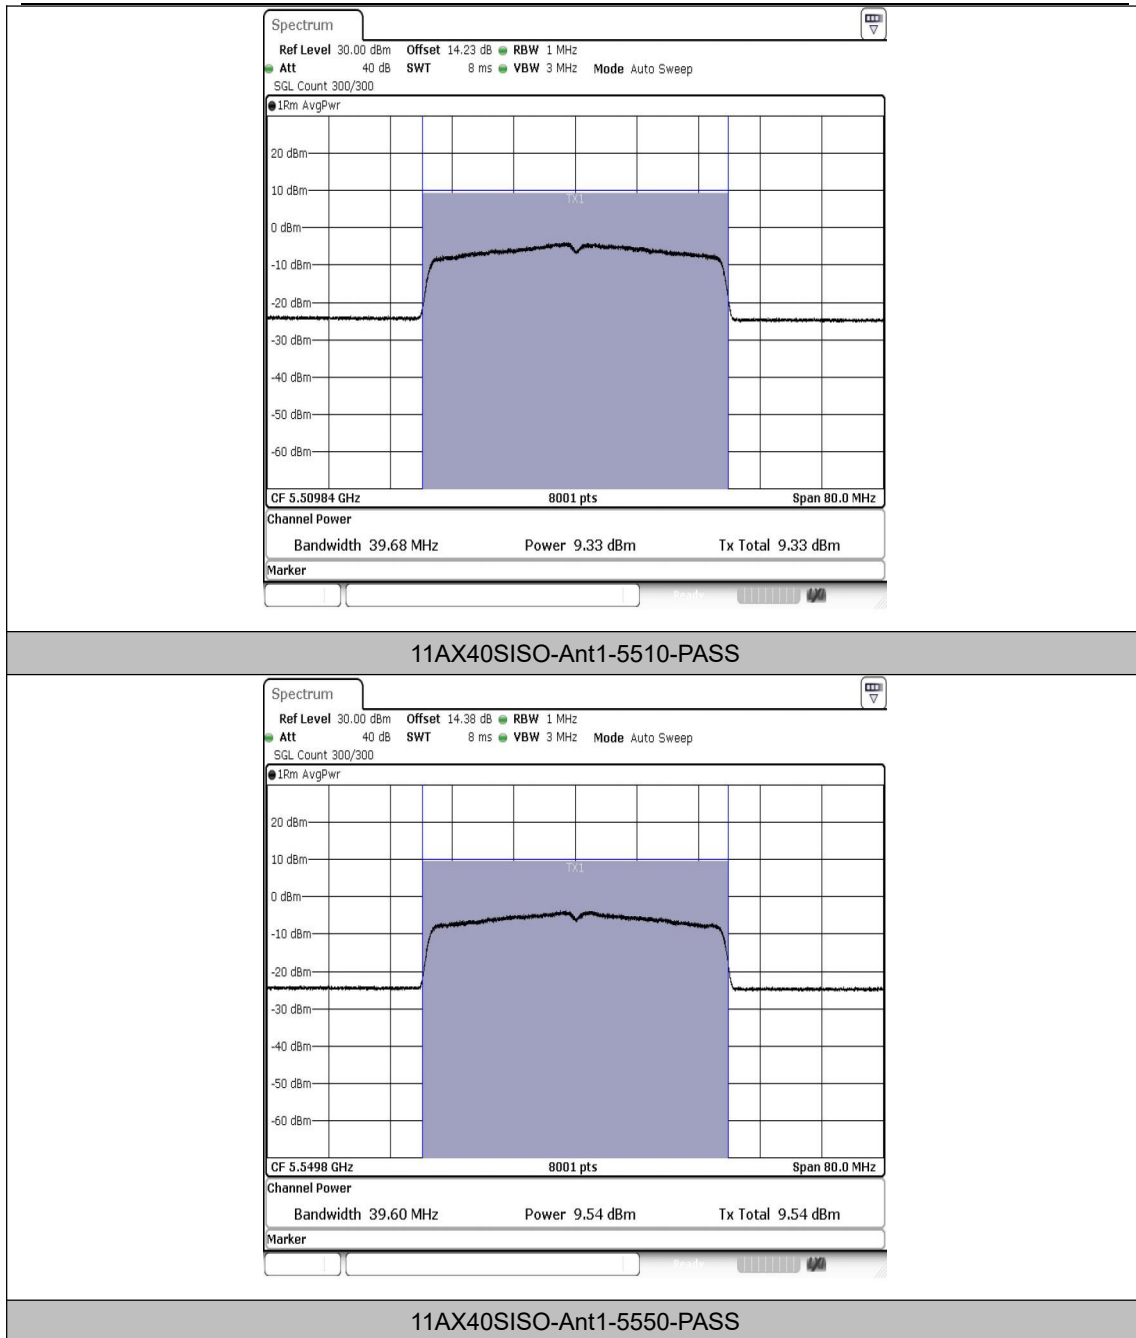



Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com



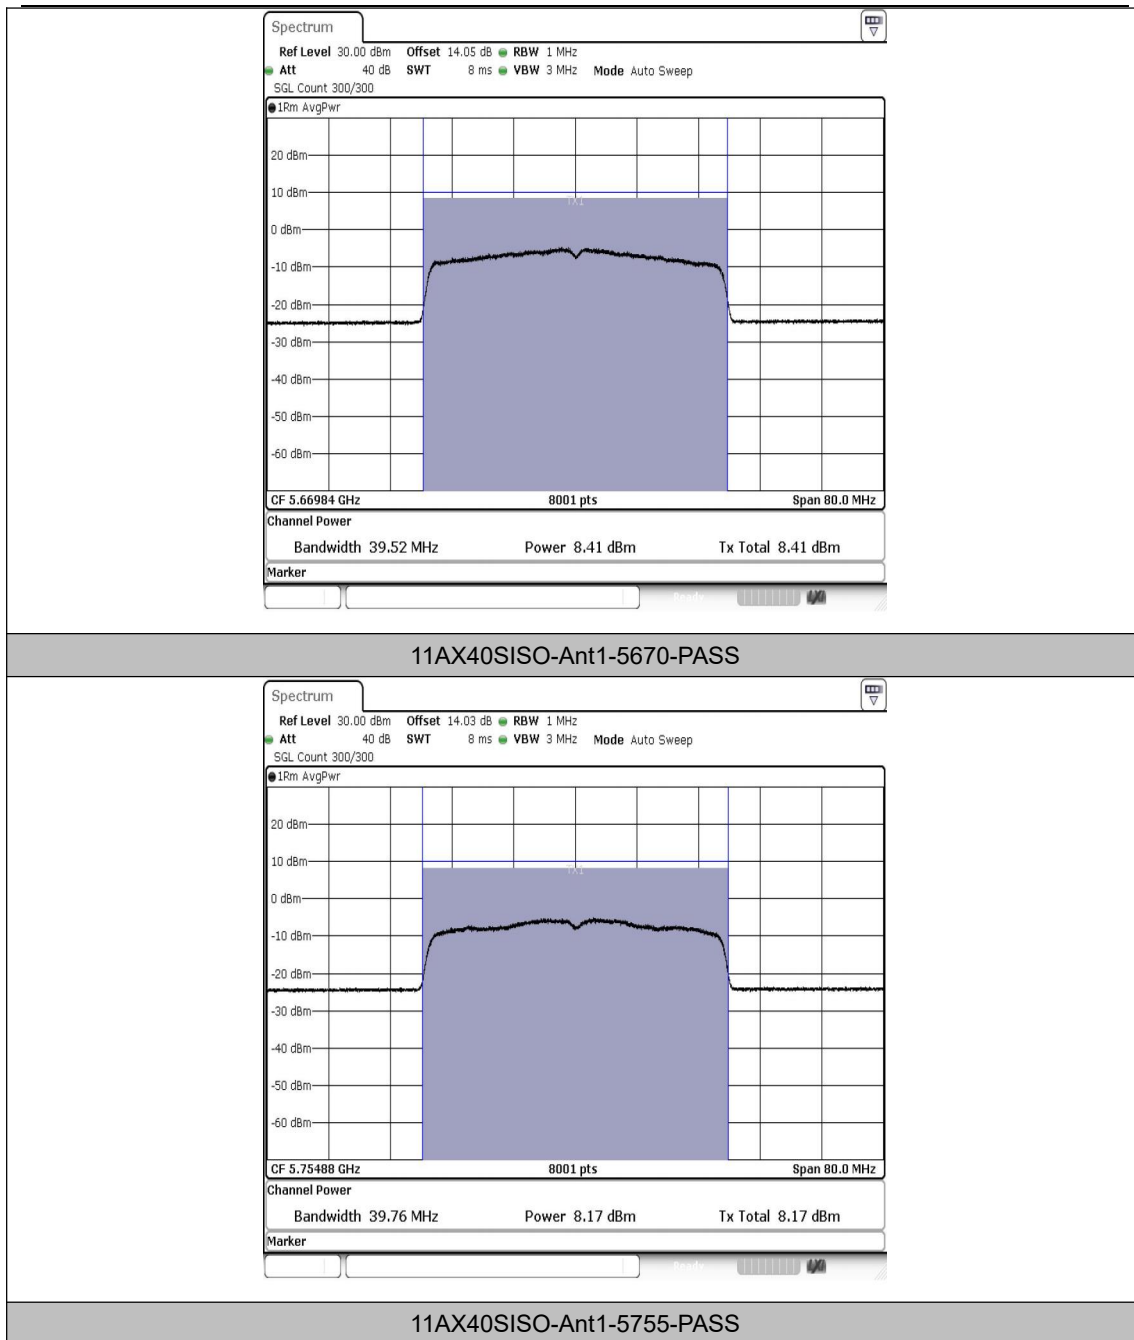

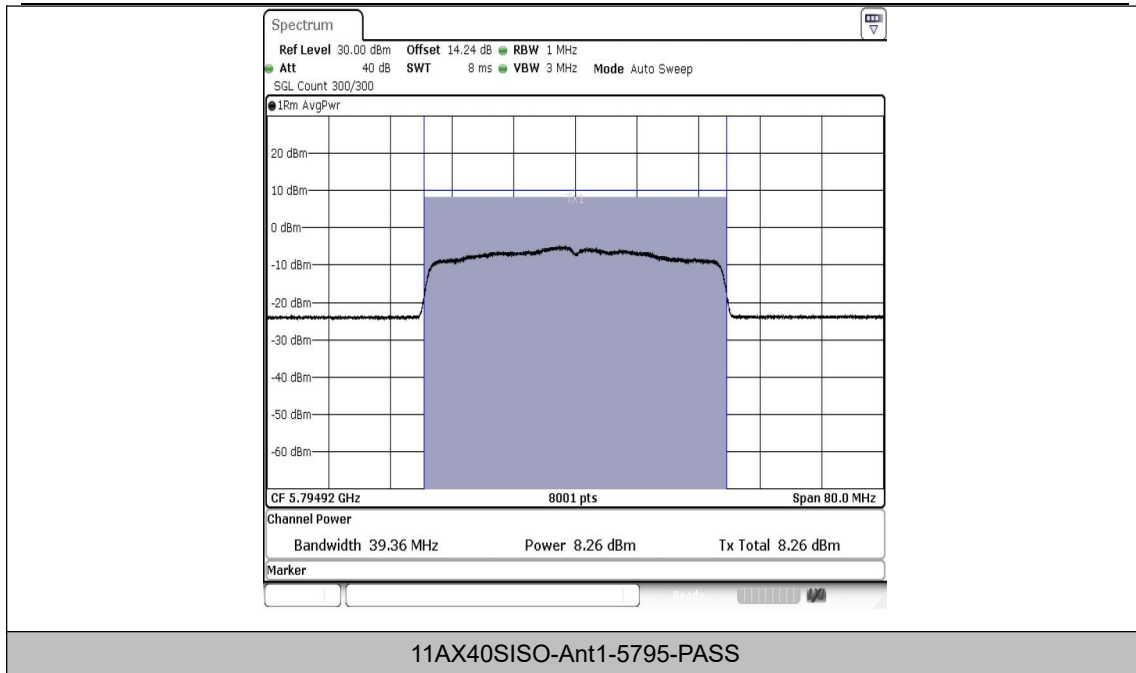

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Appendix D: Maximum Power Spectral Density

Test Result

Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm /MHz]	Verdict
11A	Ant1	5180	2.03	1.40	3.43	≤11.00	PASS
11A	Ant1	5200	1.12	1.40	2.52	≤11.00	PASS
11A	Ant1	5240	0.8	1.40	2.20	≤11.00	PASS
11A	Ant1	5260	1.66	1.43	3.09	≤10.68	PASS
11A	Ant1	5280	0.5	1.38	1.88	≤10.68	PASS
11A	Ant1	5320	1.02	1.45	2.47	≤10.68	PASS
11A	Ant1	5500	0.1	1.40	1.50	≤10.39	PASS
11A	Ant1	5580	-0.41	1.40	0.99	≤10.39	PASS
11A	Ant1	5700	-1.21	1.40	0.19	≤10.39	PASS
Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit[dBm /500KHz]	Verdict
11A	Ant1	5745	-2.81	1.38	-1.43	≤29.21	PASS
11A	Ant1	5785	-3.12	1.44	-1.68	≤29.21	PASS
11A	Ant1	5825	-4.39	1.43	-2.96	≤29.21	PASS
Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm /MHz]	Verdict
11N20SISO	Ant1	5180	0.48	1.50	1.98	≤11.00	PASS
11N20SISO	Ant1	5200	1.13	1.51	2.64	≤11.00	PASS
11N20SISO	Ant1	5240	-0.13	1.48	1.35	≤11.00	PASS
11N20SISO	Ant1	5260	0.75	1.56	2.31	≤10.68	PASS
11N20SISO	Ant1	5280	-0.23	1.46	1.23	≤10.68	PASS
11N20SISO	Ant1	5320	-0.05	1.53	1.48	≤10.68	PASS
11N20SISO	Ant1	5500	-0.21	1.46	1.25	≤10.39	PASS
11N20SISO	Ant1	5580	0.71	1.51	2.22	≤10.39	PASS
11N20SISO	Ant1	5700	-1.76	1.48	-0.28	≤10.39	PASS



Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit[dBm /500KHz]	Verdict
11N20SISO	Ant1	5745	-4.58	1.48	-3.10	≤29.21	PASS
11N20SISO	Ant1	5785	-3.71	1.56	-2.15	≤29.21	PASS
11N20SISO	Ant1	5825	-3.61	1.56	-2.05	≤29.21	PASS
Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm /MHz]	Verdict
11N40SISO	Ant1	5190	-1.9	2.07	0.17	≤11.00	PASS
11N40SISO	Ant1	5230	-2.31	2.11	-0.20	≤11.00	PASS
11N40SISO	Ant1	5270	-3.14	2.11	-1.03	≤10.68	PASS
11N40SISO	Ant1	5310	-1.86	2.11	0.25	≤10.68	PASS
11N40SISO	Ant1	5510	-3.05	3.54	0.49	≤10.39	PASS
11N40SISO	Ant1	5550	-2.86	2.04	-0.82	≤10.39	PASS
11N40SISO	Ant1	5670	-3.91	2.02	-1.89	≤10.39	PASS
Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit[dBm /500KHz]	Verdict
11N40SISO	Ant1	5755	-7.31	2.15	-5.16	≤29.21	PASS
11N40SISO	Ant1	5795	-7.56	2.04	-5.52	≤29.21	PASS
Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm /MHz]	Verdict
11AC20SISO	Ant1	5180	1.53	1.52	3.05	≤11.00	PASS
11AC20SISO	Ant1	5200	1.72	1.57	3.29	≤11.00	PASS
11AC20SISO	Ant1	5240	0.46	1.52	1.98	≤11.00	PASS
11AC20SISO	Ant1	5260	0.96	1.60	2.56	≤10.68	PASS



SO							
11AC20SI SO	Ant1	5280	0.17	1.21	1.38	≤10.68	PASS
11AC20SI SO	Ant1	5320	0.69	1.50	2.19	≤10.68	PASS
11AC20SI SO	Ant1	5500	0.55	1.50	2.05	≤10.39	PASS
11AC20SI SO	Ant1	5580	0.07	1.57	1.64	≤10.39	PASS
11AC20SI SO	Ant1	5700	-0.96	1.52	0.56	≤10.39	PASS
Test Mode	Antenna	Frequenc y[MHz]	Reading Result[dB m/MHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit[dBm /500KHz]	Verdict
11AC20SI SO	Ant1	5745	-3.28	2.44	-0.84	≤29.21	PASS
11AC20SI SO	Ant1	5785	-3.09	1.52	-1.57	≤29.21	PASS
11AC20SI SO	Ant1	5825	-3.34	1.52	-1.82	≤29.21	PASS
Test Mode	Antenna	Frequenc y[MHz]	Reading Result[dB m/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm /MHz]	Verdict
11AC40SI SO	Ant1	5190	-2.13	2.04	-0.09	≤11.00	PASS
11AC40SI SO	Ant1	5230	-2.08	1.96	-0.12	≤11.00	PASS
11AC40SI SO	Ant1	5270	-3.09	2.04	-1.05	≤10.68	PASS
11AC40SI SO	Ant1	5310	-1.83	1.96	0.13	≤10.68	PASS
11AC40SI SO	Ant1	5510	-3.49	2.55	-0.94	≤10.39	PASS
11AC40SI SO	Ant1	5550	-2.34	2.00	-0.34	≤10.39	PASS
11AC40SI SO	Ant1	5670	-3.93	1.96	-1.97	≤10.39	PASS
Test Mode	Antenna	Frequenc y[MHz]	Reading Result[dB m/MHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit[dBm /500KHz]	Verdict
11AC40SI SO	Ant1	5755	-7.44	2.04	-5.40	≤29.21	PASS
11AC40SI	Ant1	5795	-7.02	2.12	-4.90	≤29.21	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



SO							
Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm /MHz]	Verdict
11AX20SI SO	Ant1	5180	1.23	1.92	3.15	≤11.00	PASS
11AX20SI SO	Ant1	5200	0.89	1.92	2.81	≤11.00	PASS
11AX20SI SO	Ant1	5240	0.48	1.93	2.41	≤11.00	PASS
11AX20SI SO	Ant1	5260	0.19	1.97	2.16	≤10.68	PASS
11AX20SI SO	Ant1	5280	0.22	1.93	2.15	≤10.68	PASS
11AX20SI SO	Ant1	5320	0.56	1.96	2.52	≤10.68	PASS
11AX20SI SO	Ant1	5500	0.03	1.89	1.92	≤10.39	PASS
11AX20SI SO	Ant1	5580	-0.12	1.90	1.78	≤10.39	PASS
11AX20SI SO	Ant1	5700	-1.33	1.96	0.63	≤10.39	PASS
Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit[dBm /500KHz]	Verdict
11AX20SI SO	Ant1	5745	-3.38	1.93	-1.45	≤29.21	PASS
11AX20SI SO	Ant1	5785	-3.75	1.89	-1.86	≤29.21	PASS
11AX20SI SO	Ant1	5825	-3.63	1.97	-1.66	≤29.21	PASS
Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm /MHz]	Verdict
11AX40SI SO	Ant1	5190	-2.36	2.93	0.57	≤11.00	PASS
11AX40SI SO	Ant1	5230	-3.18	2.89	-0.29	≤11.00	PASS
11AX40SI SO	Ant1	5270	-3.02	2.85	-0.17	≤10.68	PASS
11AX40SI SO	Ant1	5310	-3.43	2.89	-0.54	≤10.68	PASS
11AX40SI SO	Ant1	5510	-3.83	2.89	-0.94	≤10.39	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

