




OBW NVNT ax80 5610MHz Ant2

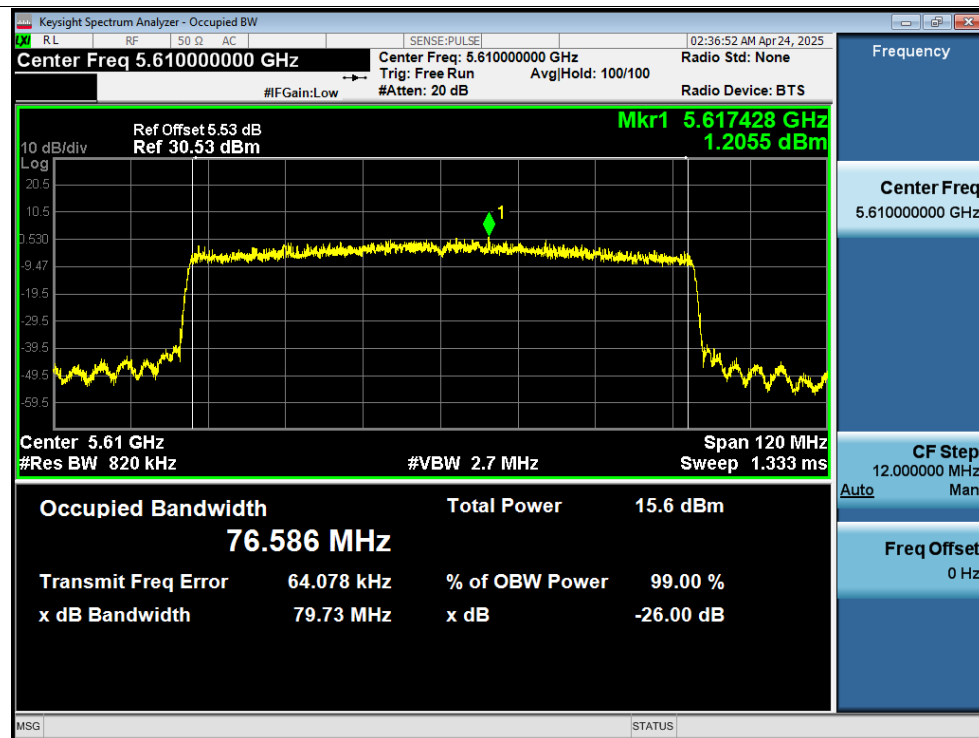


OBW NVNT ax80 5610MHz Ant3

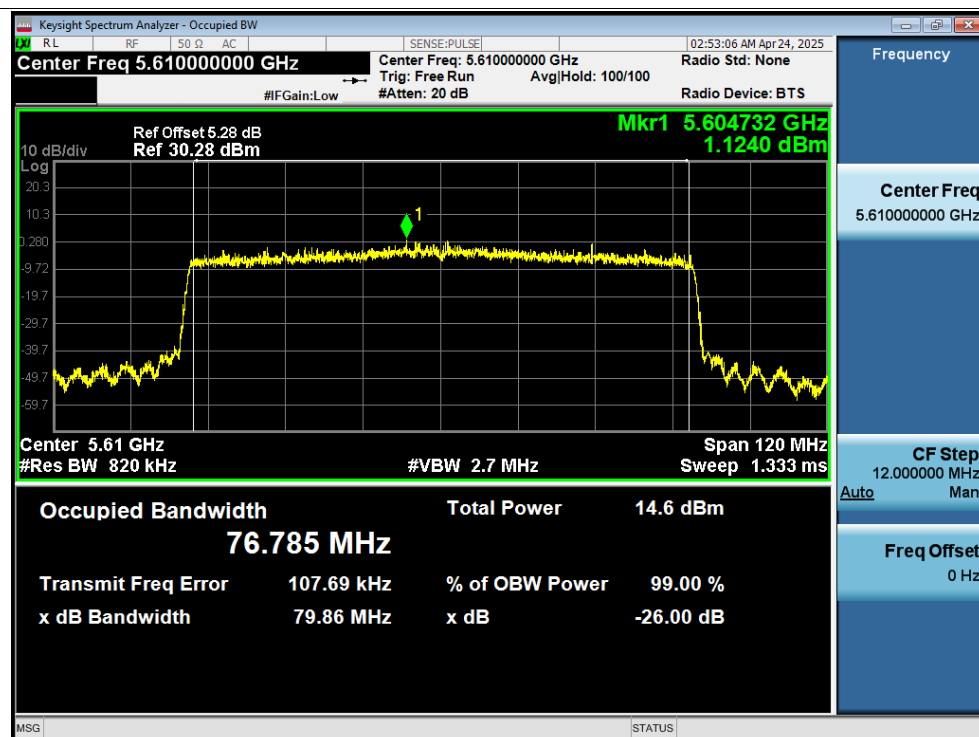


OBW NVNT ax80 5775MHz Ant1

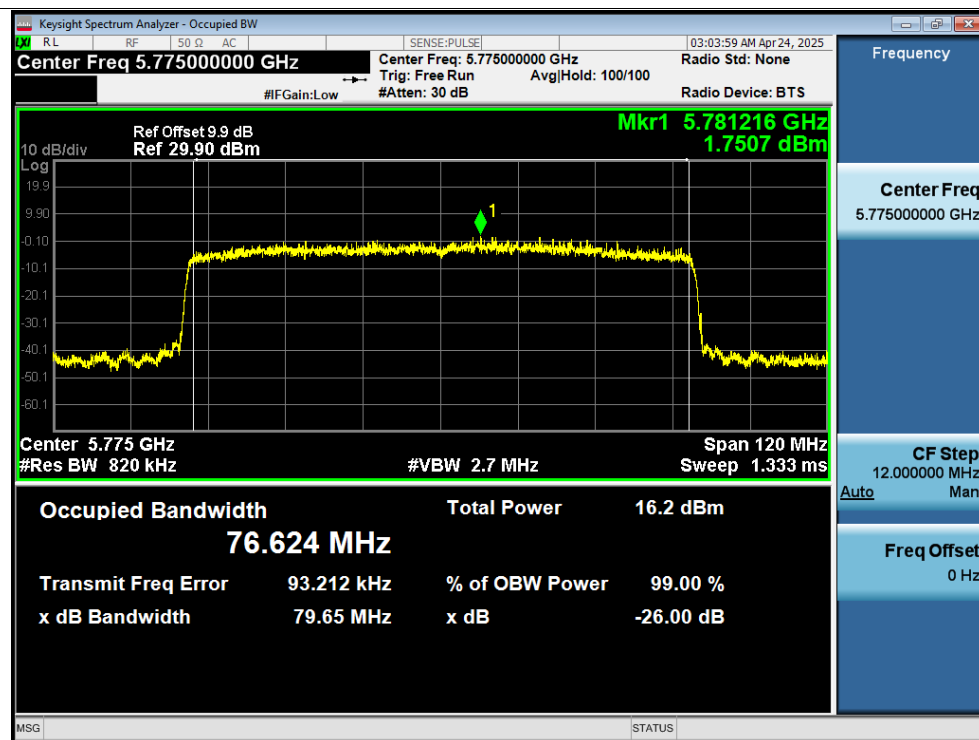

OBW NVNT ax80 5775MHz Ant2

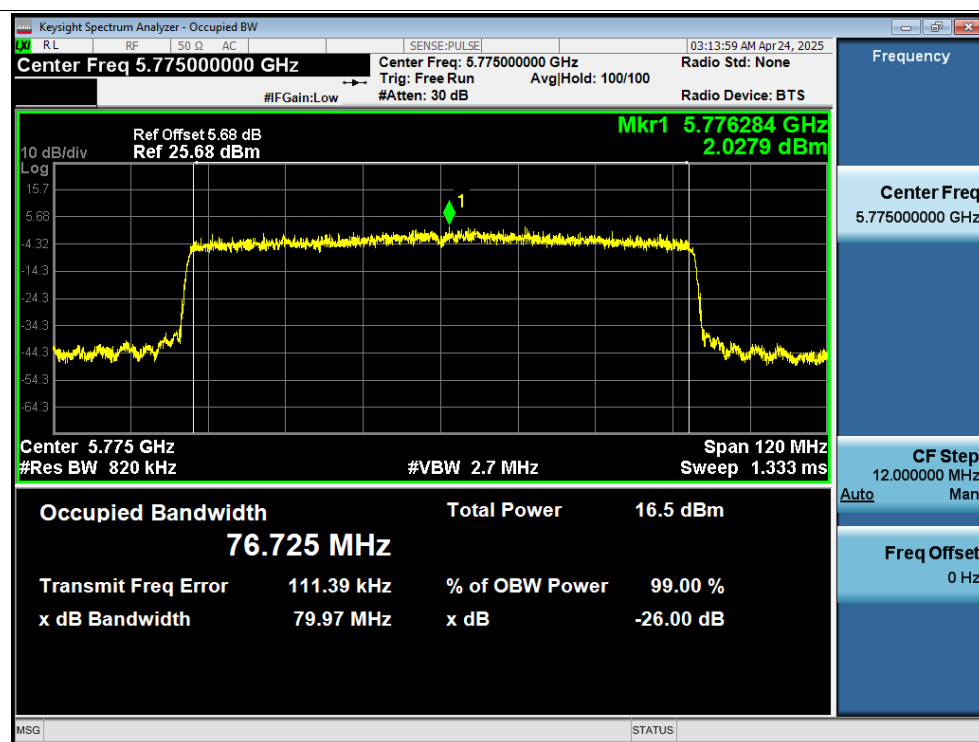

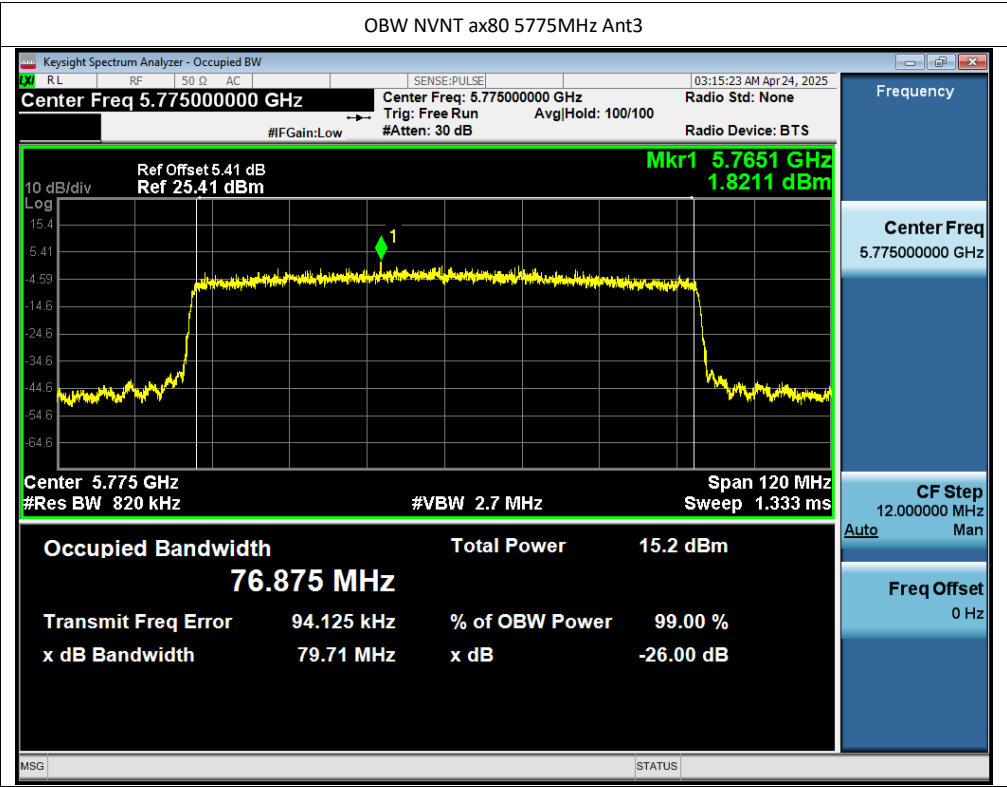

Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	6.31	0.17	6.48	14.24	Pass
NVNT	a	5180	Ant2	6.99	0.17	7.16	14.24	Pass
NVNT	a	5180	Ant3	7.4	0.17	7.57	14.24	Pass
NVNT	a	5200	Ant1	6.81	0.17	6.98	14.24	Pass
NVNT	a	5200	Ant2	6.51	0.17	6.68	14.24	Pass
NVNT	a	5200	Ant3	7.18	0.17	7.35	14.24	Pass
NVNT	a	5240	Ant1	7.2	0.17	7.37	14.24	Pass
NVNT	a	5240	Ant2	7.28	0.17	7.45	14.24	Pass
NVNT	a	5240	Ant3	7.74	0.17	7.91	14.24	Pass
NVNT	a	5260	Ant1	6.44	0.17	6.61	8.24	Pass
NVNT	a	5260	Ant2	6.12	0.17	6.29	8.24	Pass
NVNT	a	5260	Ant3	7.42	0.17	7.59	8.24	Pass
NVNT	a	5280	Ant1	7.01	0.17	7.18	8.24	Pass
NVNT	a	5280	Ant2	6.35	0.17	6.52	8.24	Pass
NVNT	a	5280	Ant3	7.42	0.17	7.59	8.24	Pass
NVNT	a	5320	Ant1	6.43	0.17	6.6	8.24	Pass
NVNT	a	5320	Ant2	5.87	0.17	6.04	8.24	Pass
NVNT	a	5320	Ant3	7.18	0.17	7.35	8.24	Pass
NVNT	a	5500	Ant1	6.42	0.17	6.59	8.24	Pass
NVNT	a	5500	Ant2	7.34	0.17	7.51	8.24	Pass
NVNT	a	5500	Ant3	7.57	0.17	7.74	8.24	Pass
NVNT	a	5600	Ant1	6.88	0.17	7.05	8.24	Pass
NVNT	a	5600	Ant2	6.86	0.17	7.03	8.24	Pass
NVNT	a	5600	Ant3	7.14	0.17	7.31	8.24	Pass
NVNT	a	5700	Ant1	6.62	0.17	6.79	8.24	Pass
NVNT	a	5700	Ant2	6.66	0.17	6.83	8.24	Pass
NVNT	a	5700	Ant3	6.88	0.17	7.05	8.24	Pass
NVNT	a	5745	Ant1	4.68	0.17	4.85	27.24	Pass
NVNT	a	5745	Ant2	4.32	0.17	4.49	27.24	Pass
NVNT	a	5745	Ant3	4.67	0.17	4.84	27.24	Pass
NVNT	a	5785	Ant1	4.71	0.17	4.88	27.24	Pass
NVNT	a	5785	Ant2	4.77	0.17	4.94	27.24	Pass
NVNT	a	5785	Ant3	4.48	0.17	4.65	27.24	Pass
NVNT	a	5825	Ant1	2.78	0.17	2.95	27.24	Pass
NVNT	a	5825	Ant2	2.4	0.17	2.57	27.24	Pass
NVNT	a	5825	Ant3	5.03	0.17	5.2	27.24	Pass
NVNT	n20	5180	Ant1	0.82	0.18	1	14.24	Pass
NVNT	n20	5180	Ant2	2.14	0.18	2.32	14.24	Pass
NVNT	n20	5180	Ant3	1.96	0.18	2.14	14.24	Pass

NVNT	n20	5180	Sum	6.45	-	6.63	14.24	Pass
NVNT	n20	5200	Ant1	1.72	0.18	1.9	14.24	Pass
NVNT	n20	5200	Ant2	1.95	0.18	2.13	14.24	Pass
NVNT	n20	5200	Ant3	1.94	0.18	2.12	14.24	Pass
NVNT	n20	5200	Sum	6.64	-	6.82	14.24	Pass
NVNT	n20	5240	Ant1	1.67	0.18	1.85	14.24	Pass
NVNT	n20	5240	Ant2	0.6	0.18	0.78	14.24	Pass
NVNT	n20	5240	Ant3	1.16	0.18	1.34	14.24	Pass
NVNT	n20	5240	Sum	5.94	-	6.12	14.24	Pass
NVNT	n20	5260	Ant1	1.71	0.18	1.89	8.24	Pass
NVNT	n20	5260	Ant2	-0.45	0.18	-0.27	8.24	Pass
NVNT	n20	5260	Ant3	0.59	0.18	0.77	8.24	Pass
NVNT	n20	5260	Sum	5.48	-	5.66	8.24	Pass
NVNT	n20	5280	Ant1	2.79	0.18	2.97	8.24	Pass
NVNT	n20	5280	Ant2	-0.33	0.18	-0.15	8.24	Pass
NVNT	n20	5280	Ant3	1.38	0.18	1.56	8.24	Pass
NVNT	n20	5280	Sum	6.23	-	6.41	8.24	Pass
NVNT	n20	5320	Ant1	2.3	0.18	2.48	8.24	Pass
NVNT	n20	5320	Ant2	-0.36	0.18	-0.18	8.24	Pass
NVNT	n20	5320	Ant3	1.16	0.18	1.34	8.24	Pass
NVNT	n20	5320	Sum	5.94	-	6.12	8.24	Pass
NVNT	n20	5500	Ant1	0.57	0.18	0.75	8.24	Pass
NVNT	n20	5500	Ant2	1.42	0.18	1.6	8.24	Pass
NVNT	n20	5500	Ant3	2.77	0.18	2.95	8.24	Pass
NVNT	n20	5500	Sum	6.46	-	6.64	8.24	Pass
NVNT	n20	5600	Ant1	2.45	0.18	2.63	8.24	Pass
NVNT	n20	5600	Ant2	0.4	0.18	0.58	8.24	Pass
NVNT	n20	5600	Ant3	1.12	0.18	1.3	8.24	Pass
NVNT	n20	5600	Sum	6.18	-	6.36	8.24	Pass
NVNT	n20	5700	Ant1	1.93	0.18	2.11	8.24	Pass
NVNT	n20	5700	Ant2	0.26	0.18	0.44	8.24	Pass
NVNT	n20	5700	Ant3	1.07	0.18	1.25	8.24	Pass
NVNT	n20	5700	Sum	5.91	-	6.09	8.24	Pass
NVNT	n20	5745	Ant1	-0.04	0.18	0.14	27.24	Pass
NVNT	n20	5745	Ant2	-2.22	0.18	-2.04	27.24	Pass
NVNT	n20	5745	Ant3	-0.58	0.18	-0.4	27.24	Pass
NVNT	n20	5745	Sum	3.92	-	4.1	27.24	Pass
NVNT	n20	5785	Ant1	-0.35	0.18	-0.17	27.24	Pass
NVNT	n20	5785	Ant2	-2.04	0.18	-1.86	27.24	Pass
NVNT	n20	5785	Ant3	-0.74	0.18	-0.56	27.24	Pass
NVNT	n20	5785	Sum	3.79	-	3.97	27.24	Pass
NVNT	n20	5825	Ant1	-2.36	0.18	-2.18	27.24	Pass

NVNT	n20	5825	Ant2	-4.55	0.18	-4.37	27.24	Pass
NVNT	n20	5825	Ant3	-0.46	0.18	-0.28	27.24	Pass
NVNT	n20	5825	Sum	2.63	-	2.81	27.24	Pass
NVNT	n40	5190	Ant1	-1.27	0.36	-0.91	14.24	Pass
NVNT	n40	5190	Ant2	-0.96	0.36	-0.6	14.24	Pass
NVNT	n40	5190	Ant3	-1.3	0.36	-0.94	14.24	Pass
NVNT	n40	5190	Sum	3.6	-	3.96	14.24	Pass
NVNT	n40	5230	Ant1	-0.87	0.36	-0.51	14.24	Pass
NVNT	n40	5230	Ant2	-1.5	0.36	-1.14	14.24	Pass
NVNT	n40	5230	Ant3	-2.8	0.36	-2.44	14.24	Pass
NVNT	n40	5230	Sum	3.12	-	3.48	14.24	Pass
NVNT	n40	5270	Ant1	-1.42	0.36	-1.06	8.24	Pass
NVNT	n40	5270	Ant2	-2.01	0.36	-1.65	8.24	Pass
NVNT	n40	5270	Ant3	-2.41	0.36	-2.05	8.24	Pass
NVNT	n40	5270	Sum	2.85	-	3.21	8.24	Pass
NVNT	n40	5310	Ant1	-1.82	0.36	-1.46	8.24	Pass
NVNT	n40	5310	Ant2	-1.75	0.36	-1.39	8.24	Pass
NVNT	n40	5310	Ant3	-2.55	0.36	-2.19	8.24	Pass
NVNT	n40	5310	Sum	2.75	-	3.11	8.24	Pass
NVNT	n40	5510	Ant1	-1.96	0.36	-1.6	8.24	Pass
NVNT	n40	5510	Ant2	-1.33	0.36	-0.97	8.24	Pass
NVNT	n40	5510	Ant3	-0.48	0.36	-0.12	8.24	Pass
NVNT	n40	5510	Sum	3.56	-	3.92	8.24	Pass
NVNT	n40	5590	Ant1	-2.55	0.36	-2.19	8.24	Pass
NVNT	n40	5590	Ant2	-1.91	0.36	-1.55	8.24	Pass
NVNT	n40	5590	Ant3	-2.75	0.36	-2.39	8.24	Pass
NVNT	n40	5590	Sum	2.38	-	2.74	8.24	Pass
NVNT	n40	5670	Ant1	-2.11	0.36	-1.75	8.24	Pass
NVNT	n40	5670	Ant2	-3.1	0.36	-2.74	8.24	Pass
NVNT	n40	5670	Ant3	-2.82	0.36	-2.46	8.24	Pass
NVNT	n40	5670	Sum	2.11	-	2.47	8.24	Pass
NVNT	n40	5755	Ant1	-3.56	0.36	-3.2	27.24	Pass
NVNT	n40	5755	Ant2	-4.39	0.36	-4.03	27.24	Pass
NVNT	n40	5755	Ant3	-4.82	0.36	-4.46	27.24	Pass
NVNT	n40	5755	Sum	0.55	-	0.91	27.24	Pass
NVNT	n40	5795	Ant1	-3.51	0.36	-3.15	27.24	Pass
NVNT	n40	5795	Ant2	-3.22	0.36	-2.86	27.24	Pass
NVNT	n40	5795	Ant3	-5.6	0.36	-5.24	27.24	Pass
NVNT	n40	5795	Sum	0.78	-	1.14	27.24	Pass
NVNT	ac20	5180	Ant1	0.56	0.48	1.04	14.24	Pass
NVNT	ac20	5180	Ant2	1.69	0.48	2.17	14.24	Pass
NVNT	ac20	5180	Ant3	1.57	0.48	2.05	14.24	Pass

NVNT	ac20	5180	Sum	6.07	-	6.55	14.24	Pass
NVNT	ac20	5200	Ant1	2.31	0.48	2.79	14.24	Pass
NVNT	ac20	5200	Ant2	1.46	0.48	1.94	14.24	Pass
NVNT	ac20	5200	Ant3	0.8	0.48	1.28	14.24	Pass
NVNT	ac20	5200	Sum	6.34	-	6.82	14.24	Pass
NVNT	ac20	5240	Ant1	2.46	0.48	2.94	14.24	Pass
NVNT	ac20	5240	Ant2	1.67	0.48	2.15	14.24	Pass
NVNT	ac20	5240	Ant3	0.86	0.48	1.34	14.24	Pass
NVNT	ac20	5240	Sum	6.48	-	6.96	14.24	Pass
NVNT	ac20	5260	Ant1	1.03	0.48	1.51	8.24	Pass
NVNT	ac20	5260	Ant2	0.72	0.48	1.2	8.24	Pass
NVNT	ac20	5260	Ant3	0.91	0.48	1.39	8.24	Pass
NVNT	ac20	5260	Sum	5.66	-	6.14	8.24	Pass
NVNT	ac20	5280	Ant1	2.4	0.48	2.88	8.24	Pass
NVNT	ac20	5280	Ant2	1.28	0.48	1.76	8.24	Pass
NVNT	ac20	5280	Ant3	0.96	0.48	1.44	8.24	Pass
NVNT	ac20	5280	Sum	6.37	-	6.85	8.24	Pass
NVNT	ac20	5320	Ant1	1.66	0.48	2.14	8.24	Pass
NVNT	ac20	5320	Ant2	0.23	0.48	0.71	8.24	Pass
NVNT	ac20	5320	Ant3	1.05	0.48	1.53	8.24	Pass
NVNT	ac20	5320	Sum	5.79	-	6.27	8.24	Pass
NVNT	ac20	5500	Ant1	0.56	0.48	1.04	8.24	Pass
NVNT	ac20	5500	Ant2	0.97	0.48	1.45	8.24	Pass
NVNT	ac20	5500	Ant3	2.43	0.48	2.91	8.24	Pass
NVNT	ac20	5500	Sum	6.17	-	6.65	8.24	Pass
NVNT	ac20	5600	Ant1	2.28	0.48	2.76	8.24	Pass
NVNT	ac20	5600	Ant2	0.06	0.48	0.54	8.24	Pass
NVNT	ac20	5600	Ant3	0.53	0.48	1.01	8.24	Pass
NVNT	ac20	5600	Sum	5.84	-	6.32	8.24	Pass
NVNT	ac20	5700	Ant1	2.24	0.48	2.72	8.24	Pass
NVNT	ac20	5700	Ant2	-0.46	0.48	0.02	8.24	Pass
NVNT	ac20	5700	Ant3	0.94	0.48	1.42	8.24	Pass
NVNT	ac20	5700	Sum	5.82	-	6.3	8.24	Pass
NVNT	ac20	5745	Ant1	-0.16	0.48	0.32	27.24	Pass
NVNT	ac20	5745	Ant2	-2.6	0.48	-2.12	27.24	Pass
NVNT	ac20	5745	Ant3	-0.59	0.48	-0.11	27.24	Pass
NVNT	ac20	5745	Sum	3.78	-	4.26	27.24	Pass
NVNT	ac20	5785	Ant1	-0.31	0.48	0.17	27.24	Pass
NVNT	ac20	5785	Ant2	-2.84	0.48	-2.36	27.24	Pass
NVNT	ac20	5785	Ant3	-0.69	0.48	-0.21	27.24	Pass
NVNT	ac20	5785	Sum	3.63	-	4.11	27.24	Pass
NVNT	ac20	5825	Ant1	-2.52	0.48	-2.04	27.24	Pass

NVNT	ac20	5825	Ant2	-4.94	0.48	-4.46	27.24	Pass
NVNT	ac20	5825	Ant3	-0.57	0.48	-0.09	27.24	Pass
NVNT	ac20	5825	Sum	2.45	-	2.93	27.24	Pass
NVNT	ac40	5190	Ant1	-2.06	0.84	-1.22	14.24	Pass
NVNT	ac40	5190	Ant2	-1.62	0.84	-0.78	14.24	Pass
NVNT	ac40	5190	Ant3	-2.04	0.84	-1.2	14.24	Pass
NVNT	ac40	5190	Sum	2.87	-	3.71	14.24	Pass
NVNT	ac40	5230	Ant1	-1.58	0.84	-0.74	14.24	Pass
NVNT	ac40	5230	Ant2	-1.98	0.84	-1.14	14.24	Pass
NVNT	ac40	5230	Ant3	-3.2	0.84	-2.36	14.24	Pass
NVNT	ac40	5230	Sum	2.57	-	3.41	14.24	Pass
NVNT	ac40	5270	Ant1	-1.93	0.84	-1.09	8.24	Pass
NVNT	ac40	5270	Ant2	-2.34	0.84	-1.5	8.24	Pass
NVNT	ac40	5270	Ant3	-2.99	0.84	-2.15	8.24	Pass
NVNT	ac40	5270	Sum	2.37	-	3.21	8.24	Pass
NVNT	ac40	5310	Ant1	-2.28	0.84	-1.44	8.24	Pass
NVNT	ac40	5310	Ant2	-2.45	0.84	-1.61	8.24	Pass
NVNT	ac40	5310	Ant3	-2.92	0.84	-2.08	8.24	Pass
NVNT	ac40	5310	Sum	2.23	-	3.07	8.24	Pass
NVNT	ac40	5510	Ant1	-2.38	0.84	-1.54	8.24	Pass
NVNT	ac40	5510	Ant2	-1.19	0.84	-0.35	8.24	Pass
NVNT	ac40	5510	Ant3	-1.01	0.84	-0.17	8.24	Pass
NVNT	ac40	5510	Sum	3.29	-	4.13	8.24	Pass
NVNT	ac40	5590	Ant1	-3.12	0.84	-2.28	8.24	Pass
NVNT	ac40	5590	Ant2	-2.29	0.84	-1.45	8.24	Pass
NVNT	ac40	5590	Ant3	-3.13	0.84	-2.29	8.24	Pass
NVNT	ac40	5590	Sum	1.95	-	2.79	8.24	Pass
NVNT	ac40	5670	Ant1	-2.42	0.84	-1.58	8.24	Pass
NVNT	ac40	5670	Ant2	-3.32	0.84	-2.48	8.24	Pass
NVNT	ac40	5670	Ant3	-3.28	0.84	-2.44	8.24	Pass
NVNT	ac40	5670	Sum	1.78	-	2.62	8.24	Pass
NVNT	ac40	5755	Ant1	-4.08	0.84	-3.24	27.24	Pass
NVNT	ac40	5755	Ant2	-4.77	0.84	-3.93	27.24	Pass
NVNT	ac40	5755	Ant3	-5.41	0.84	-4.57	27.24	Pass
NVNT	ac40	5755	Sum	0.05	-	0.89	27.24	Pass
NVNT	ac40	5795	Ant1	-3.76	0.84	-2.92	27.24	Pass
NVNT	ac40	5795	Ant2	-3.93	0.84	-3.09	27.24	Pass
NVNT	ac40	5795	Ant3	-5.79	0.84	-4.95	27.24	Pass
NVNT	ac40	5795	Sum	0.37	-	1.21	27.24	Pass
NVNT	ac80	5210	Ant1	-5.67	1.39	-4.28	14.24	Pass
NVNT	ac80	5210	Ant2	-6.67	1.41	-5.26	14.24	Pass
NVNT	ac80	5210	Ant3	-7.45	1.39	-6.06	14.24	Pass

NVNT	ac80	5210	Sum	-1.76	-	-0.37	14.24	Pass
NVNT	ac80	5290	Ant1	-6.56	1.39	-5.17	8.24	Pass
NVNT	ac80	5290	Ant2	-7.53	1.39	-6.14	8.24	Pass
NVNT	ac80	5290	Ant3	-7.67	1.39	-6.28	8.24	Pass
NVNT	ac80	5290	Sum	-2.46	-	-1.07	8.24	Pass
NVNT	ac80	5530	Ant1	-6.32	1.39	-4.93	8.24	Pass
NVNT	ac80	5530	Ant2	-7.2	1.39	-5.81	8.24	Pass
NVNT	ac80	5530	Ant3	-6.58	1.39	-5.19	8.24	Pass
NVNT	ac80	5530	Sum	-1.91	-	-0.52	8.24	Pass
NVNT	ac80	5610	Ant1	-5.73	1.39	-4.34	8.24	Pass
NVNT	ac80	5610	Ant2	-6.97	1.39	-5.58	8.24	Pass
NVNT	ac80	5610	Ant3	-7.5	1.39	-6.11	8.24	Pass
NVNT	ac80	5610	Sum	-1.9	-	-0.51	8.24	Pass
NVNT	ac80	5775	Ant1	-9.87	1.39	-8.48	27.24	Pass
NVNT	ac80	5775	Ant2	-9.36	1.39	-7.97	27.24	Pass
NVNT	ac80	5775	Ant3	-10.17	1.39	-8.78	27.24	Pass
NVNT	ac80	5775	Sum	-5.02	-	-3.63	27.24	Pass
NVNT	ac160	5250	Ant1	-11.53	1.76	-9.77	14.24	Pass
NVNT	ac160	5250	Ant2	-12.64	1.79	-10.85	14.24	Pass
NVNT	ac160	5250	Ant3	-13.73	1.79	-11.94	14.24	Pass
NVNT	ac160	5250	Sum	-7.77	-	-6	14.24	Pass
NVNT	ac160	5570	Ant1	-12.14	1.76	-10.38	8.24	Pass
NVNT	ac160	5570	Ant2	-12.67	1.79	-10.88	8.24	Pass
NVNT	ac160	5570	Ant3	-12.49	1.79	-10.7	8.24	Pass
NVNT	ac160	5570	Sum	-7.66		-5.89	8.24	Pass
NVNT	ax160	5250	Ant1	-10.98	0.51	-10.47	8.24	Pass
NVNT	ax160	5250	Ant2	-11.58	0.5	-11.08	8.24	Pass
NVNT	ax160	5250	Ant3	-12.59	0.5	-12.09	8.24	Pass
NVNT	ax160	5250	Sum	-6.9	-	-6.39	8.24	Pass
NVNT	ax160	5570	Ant1	-11.07	0.51	-10.56	8.24	Pass
NVNT	ax160	5570	Ant2	-11.28	0.5	-10.78	8.24	Pass
NVNT	ax160	5570	Ant3	-11.6	0.5	-11.1	8.24	Pass
NVNT	ax160	5570	Sum	-6.54	-	-6.03	8.24	Pass
NVNT	ax20	5180	Ant1	-0.7	0.52	-0.18	14.24	Pass
NVNT	ax20	5180	Ant2	0.84	0.53	1.37	14.24	Pass
NVNT	ax20	5180	Ant3	1.18	0.53	1.71	14.24	Pass
NVNT	ax20	5180	Sum	5.29	-	5.81	14.24	Pass
NVNT	ax20	5200	Ant1	1.25	0.52	1.77	14.24	Pass
NVNT	ax20	5200	Ant2	1.03	0.53	1.56	14.24	Pass
NVNT	ax20	5200	Ant3	0.13	0.53	0.66	14.24	Pass
NVNT	ax20	5200	Sum	5.6	-	6.12	14.24	Pass
NVNT	ax20	5240	Ant1	1.73	0.52	2.25	14.24	Pass


NVNT	ax20	5240	Ant2	0.71	0.53	1.24	14.24	Pass
NVNT	ax20	5240	Ant3	-0.12	0.53	0.41	14.24	Pass
NVNT	ax20	5240	Sum	5.61	-	6.13	14.24	Pass
NVNT	ax20	5260	Ant1	0.42	0.52	0.94	8.24	Pass
NVNT	ax20	5260	Ant2	-0.28	0.53	0.25	8.24	Pass
NVNT	ax20	5260	Ant3	-0.56	0.53	-0.03	8.24	Pass
NVNT	ax20	5260	Sum	4.65	-	5.17	8.24	Pass
NVNT	ax20	5280	Ant1	1.26	0.52	1.78	8.24	Pass
NVNT	ax20	5280	Ant2	0.71	0.53	1.24	8.24	Pass
NVNT	ax20	5280	Ant3	-0.06	0.53	0.47	8.24	Pass
NVNT	ax20	5280	Sum	5.44	-	5.96	8.24	Pass
NVNT	ax20	5320	Ant1	0.63	0.52	1.15	8.24	Pass
NVNT	ax20	5320	Ant2	0.05	0.53	0.58	8.24	Pass
NVNT	ax20	5320	Ant3	-0.23	0.53	0.3	8.24	Pass
NVNT	ax20	5320	Sum	4.94	-	5.46	8.24	Pass
NVNT	ax20	5500	Ant1	-3.22	0.52	-2.7	8.24	Pass
NVNT	ax20	5500	Ant2	-1.25	0.53	-0.72	8.24	Pass
NVNT	ax20	5500	Ant3	-0.82	0.53	-0.29	8.24	Pass
NVNT	ax20	5500	Sum	3.13	-	3.65	8.24	Pass
NVNT	ax20	5600	Ant1	-0.58	0.52	-0.06	8.24	Pass
NVNT	ax20	5600	Ant2	-1.56	0.53	-1.03	8.24	Pass
NVNT	ax20	5600	Ant3	-1.98	0.53	-1.45	8.24	Pass
NVNT	ax20	5600	Sum	3.44	-	3.96	8.24	Pass
NVNT	ax20	5700	Ant1	0.57	0.52	1.09	8.24	Pass
NVNT	ax20	5700	Ant2	1.31	0.53	1.84	8.24	Pass
NVNT	ax20	5700	Ant3	-0.14	0.53	0.39	8.24	Pass
NVNT	ax20	5700	Sum	5.39	-	5.91	8.24	Pass
NVNT	ax20	5745	Ant1	-2.06	0.52	-1.54	27.24	Pass
NVNT	ax20	5745	Ant2	-2.03	0.53	-1.5	27.24	Pass
NVNT	ax20	5745	Ant3	-2.65	0.53	-2.12	27.24	Pass
NVNT	ax20	5745	Sum	2.54	-	3.06	27.24	Pass
NVNT	ax20	5785	Ant1	-2.17	0.52	-1.65	27.24	Pass
NVNT	ax20	5785	Ant2	-1.44	0.53	-0.91	27.24	Pass
NVNT	ax20	5785	Ant3	-2.54	0.53	-2.01	27.24	Pass
NVNT	ax20	5785	Sum	2.75	-	3.27	27.24	Pass
NVNT	ax20	5825	Ant1	-4.67	0.52	-4.15	27.24	Pass
NVNT	ax20	5825	Ant2	-4.15	0.53	-3.62	27.24	Pass
NVNT	ax20	5825	Ant3	-2.72	0.53	-2.19	27.24	Pass
NVNT	ax20	5825	Sum	1.01	-	1.53	27.24	Pass
NVNT	ax40	5190	Ant1	-3.19	0.82	-2.37	14.24	Pass
NVNT	ax40	5190	Ant2	-5.5	0.82	-4.68	14.24	Pass
NVNT	ax40	5190	Ant3	-2.36	0.83	-1.53	14.24	Pass

NVNT	ax40	5190	Sum	1.28	-	2.1	14.24	Pass
NVNT	ax40	5230	Ant1	-2.46	0.82	-2.46	14.24	Pass
NVNT	ax40	5230	Ant2	-3.34	0.82	-3.34	14.24	Pass
NVNT	ax40	5230	Ant3	-4.05	0.83	-4.05	14.24	Pass
NVNT	ax40	5230	Sum	1.53	0.82	1.53	14.24	Pass
NVNT	ax40	5270	Ant1	-2.86	0.82	-2.04	8.24	Pass
NVNT	ax40	5270	Ant2	-3.28	0.82	-2.46	8.24	Pass
NVNT	ax40	5270	Ant3	-4.2	0.83	-3.37	8.24	Pass
NVNT	ax40	5270	Sum	1.36	-	2.18	8.24	Pass
NVNT	ax40	5310	Ant1	-3.24	0.82	-2.42	8.24	Pass
NVNT	ax40	5310	Ant2	-3.32	0.82	-2.5	8.24	Pass
NVNT	ax40	5310	Ant3	-3.85	0.83	-3.02	8.24	Pass
NVNT	ax40	5310	Sum	1.31	-	2.13	8.24	Pass
NVNT	ax40	5510	Ant1	-3.48	0.82	-2.66	8.24	Pass
NVNT	ax40	5510	Ant2	-2.26	0.82	-1.44	8.24	Pass
NVNT	ax40	5510	Ant3	-2.21	0.83	-1.38	8.24	Pass
NVNT	ax40	5510	Sum	2.16	-	2.98	8.24	Pass
NVNT	ax40	5590	Ant1	-4.12	0.82	-3.3	8.24	Pass
NVNT	ax40	5590	Ant2	-3.32	0.82	-2.5	8.24	Pass
NVNT	ax40	5590	Ant3	-3.97	0.83	-3.14	8.24	Pass
NVNT	ax40	5590	Sum	0.98	-	1.8	8.24	Pass
NVNT	ax40	5670	Ant1	-3.07	0.82	-2.25	8.24	Pass
NVNT	ax40	5670	Ant2	-4.68	0.82	-3.86	8.24	Pass
NVNT	ax40	5670	Ant3	-4.43	0.83	-3.6	8.24	Pass
NVNT	ax40	5670	Sum	0.77	-	1.59	8.24	Pass
NVNT	ax40	5755	Ant1	-4.8	0.82	-3.98	27.24	Pass
NVNT	ax40	5755	Ant2	-5.6	0.82	-4.78	27.24	Pass
NVNT	ax40	5755	Ant3	-6.04	0.83	-5.21	27.24	Pass
NVNT	ax40	5755	Sum	-0.68	-	0.14	27.24	Pass
NVNT	ax40	5795	Ant1	-4.43	0.82	-3.61	27.24	Pass
NVNT	ax40	5795	Ant2	-4.5	0.82	-3.68	27.24	Pass
NVNT	ax40	5795	Ant3	-6.69	0.83	-5.86	27.24	Pass
NVNT	ax40	5795	Sum	-0.31	-	0.51	27.24	Pass
NVNT	ax80	5210	Ant1	-6.33	1.15	-5.18	14.24	Pass
NVNT	ax80	5210	Ant2	-7.32	1.15	-6.17	14.24	Pass
NVNT	ax80	5210	Ant3	-8.67	1.15	-7.52	14.24	Pass
NVNT	ax80	5210	Sum	-2.57	-	-1.42	14.24	Pass
NVNT	ax80	5290	Ant1	-7.29	1.15	-6.14	8.24	Pass
NVNT	ax80	5290	Ant2	-8.33	1.15	-7.18	8.24	Pass
NVNT	ax80	5290	Ant3	-8.66	1.15	-7.51	8.24	Pass
NVNT	ax80	5290	Sum	-3.28	1.15	-2.13	8.24	Pass
NVNT	ax80	5530	Ant1	-6.97	1.15	-5.82	8.24	Pass


NVNT	ax80	5530	Ant2	-7.68	1.15	-6.53	8.24	Pass
NVNT	ax80	5530	Ant3	-7.88	1.15	-6.73	8.24	Pass
NVNT	ax80	5530	Sum	-2.72	1.15	-1.57	8.24	Pass
NVNT	ax80	5610	Ant1	-6.84	1.15	-5.69	8.24	Pass
NVNT	ax80	5610	Ant2	-7.48	1.15	-6.33	8.24	Pass
NVNT	ax80	5610	Ant3	-8.38	1.15	-7.23	8.24	Pass
NVNT	ax80	5610	Sum	-2.75	1.15	-1.6	8.24	Pass
NVNT	ax80	5775	Ant1	-10.49	1.15	-9.34	27.24	Pass
NVNT	ax80	5775	Ant2	-9.91	1.15	-8.76	27.24	Pass
NVNT	ax80	5775	Ant3	-11.24	1.15	-10.09	27.24	Pass
NVNT	ax80	5775	Sum	-5.74	1.15	-4.59	27.24	Pass

Test Graphs


PSD NVNT a 5180MHz Ant1

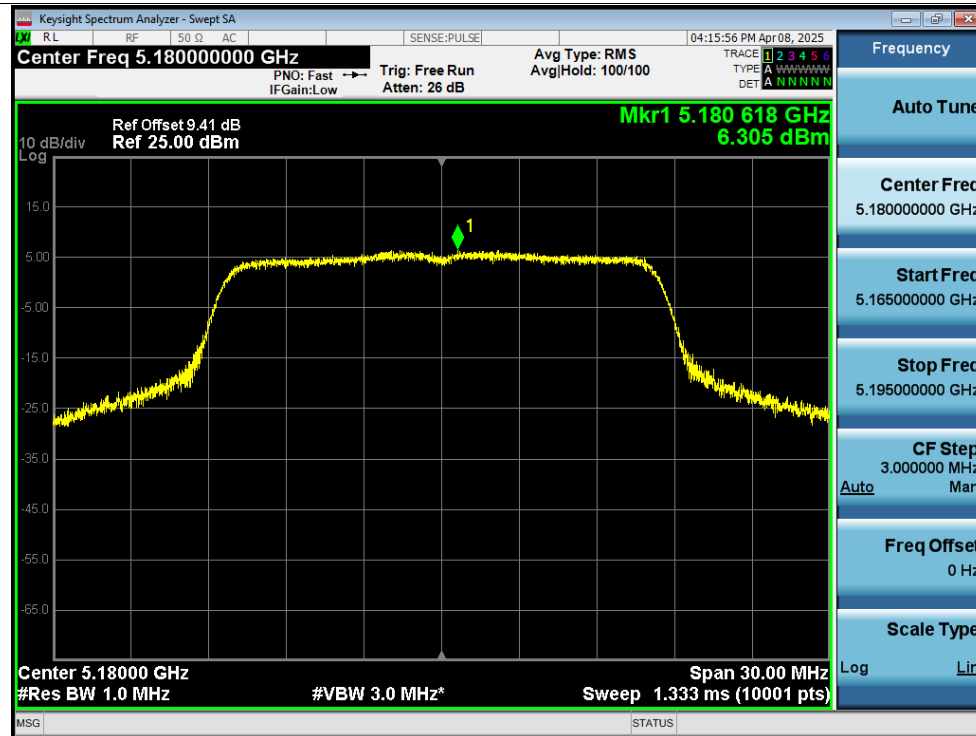


PSD NVNT a 5180MHz Ant2

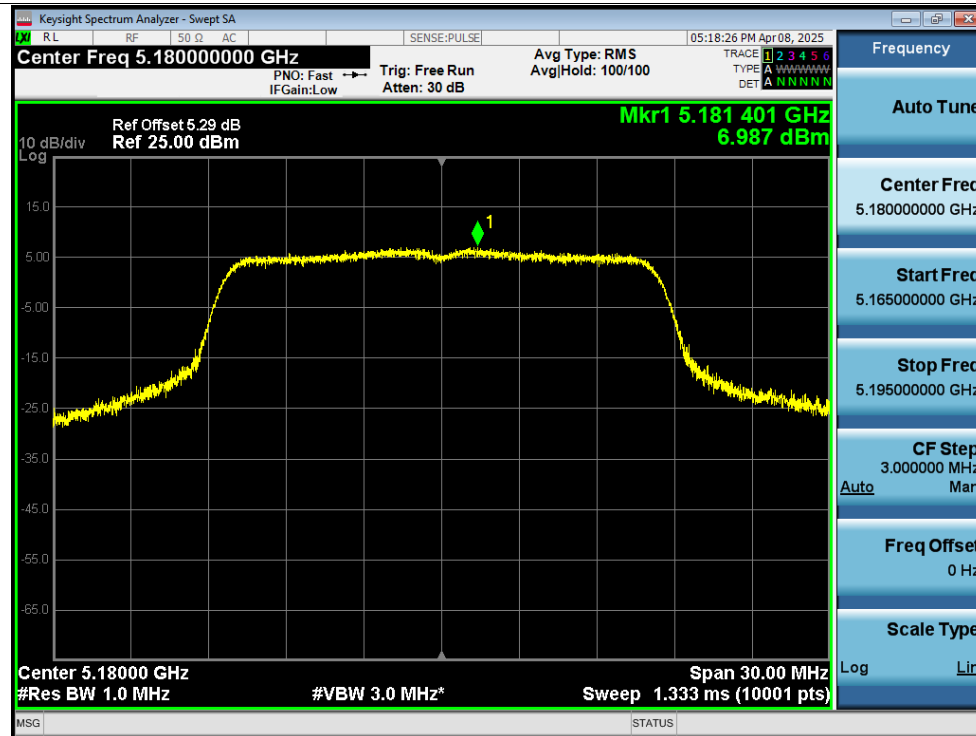

PSD NVNT a 5180MHz Ant3

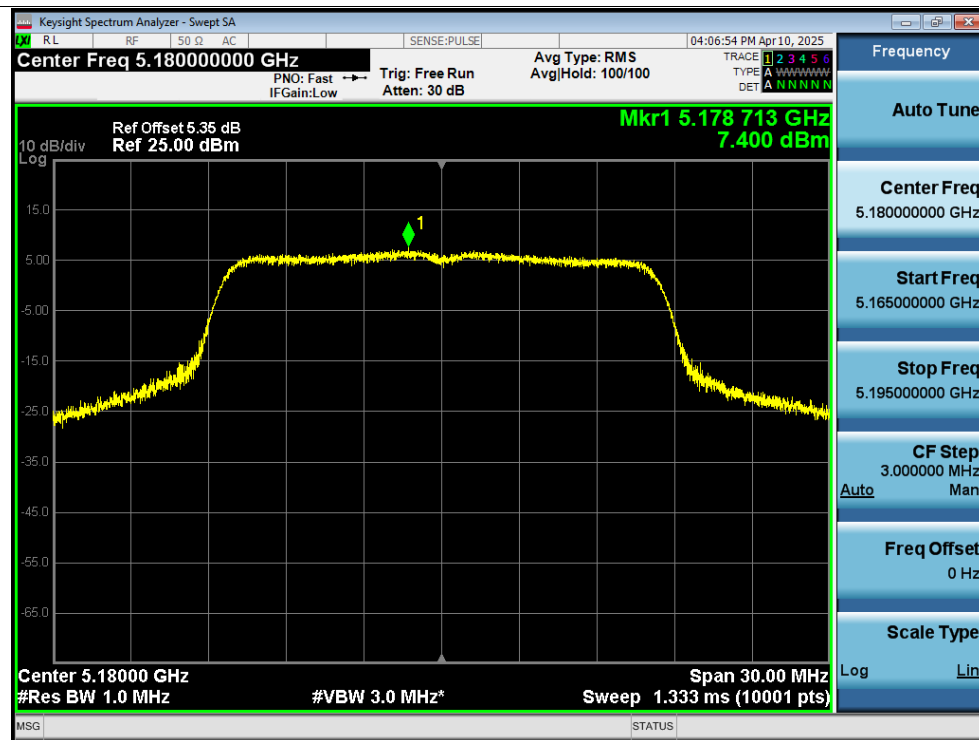


PSD NVNT a 5200MHz Ant1

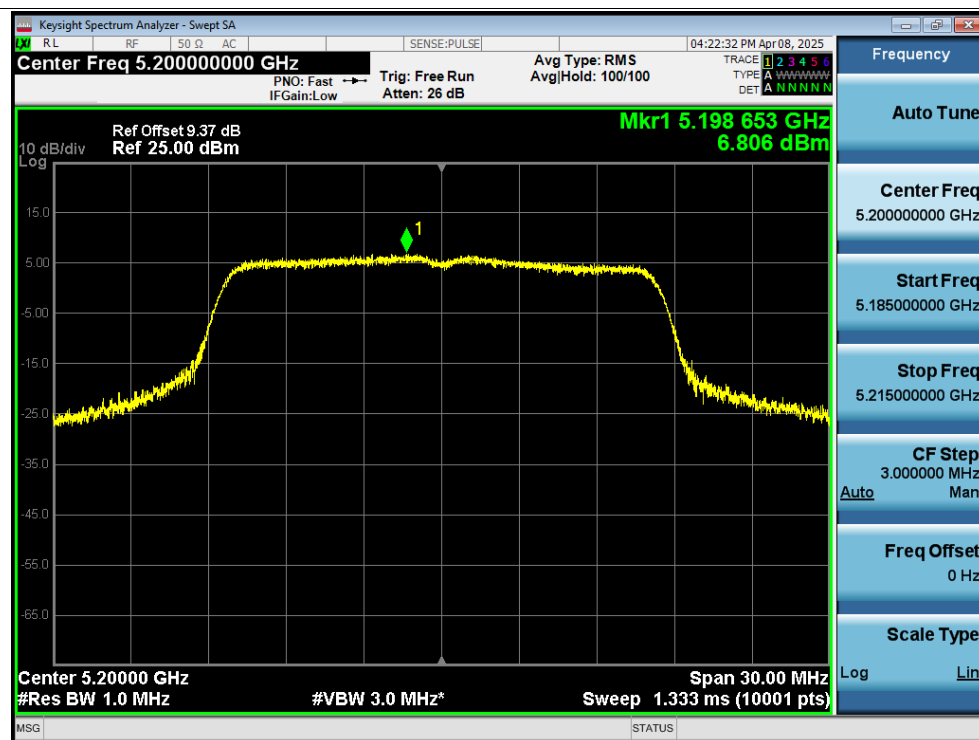


PSD NVNT a 5200MHz Ant2




PSD NVNT a 5200MHz Ant3

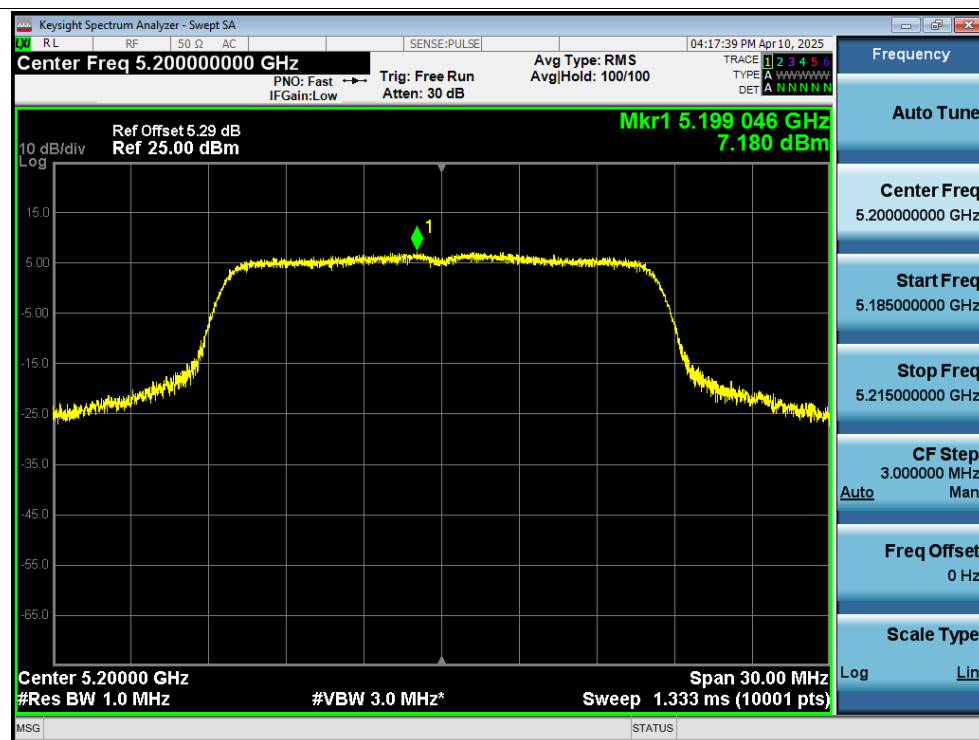


PSD NVNT a 5240MHz Ant1

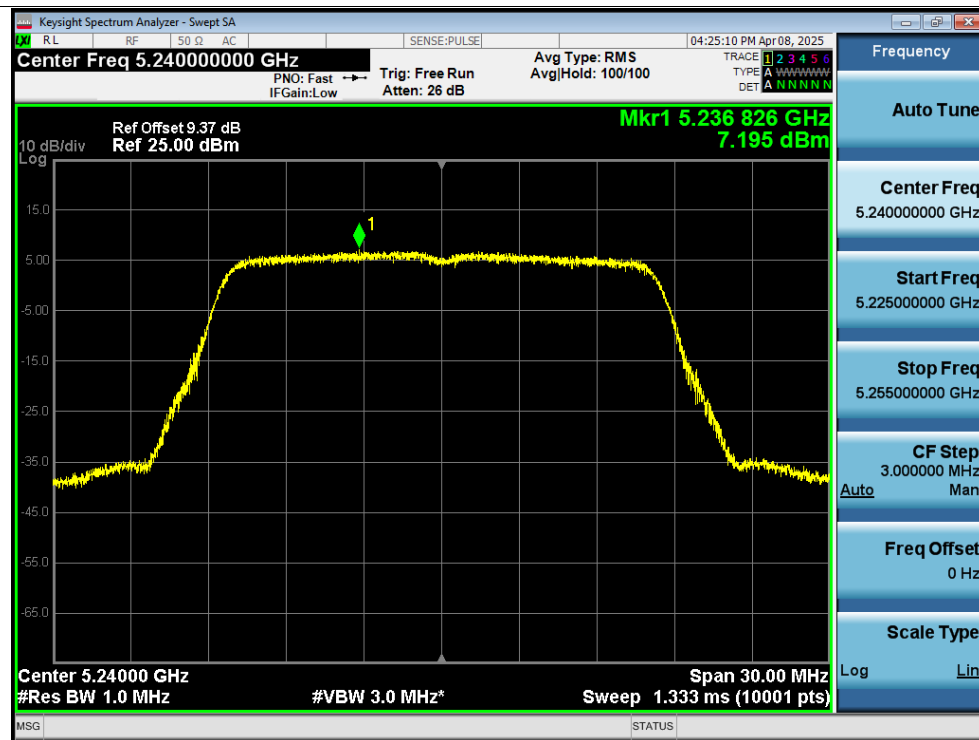


PSD NVNT a 5240MHz Ant2

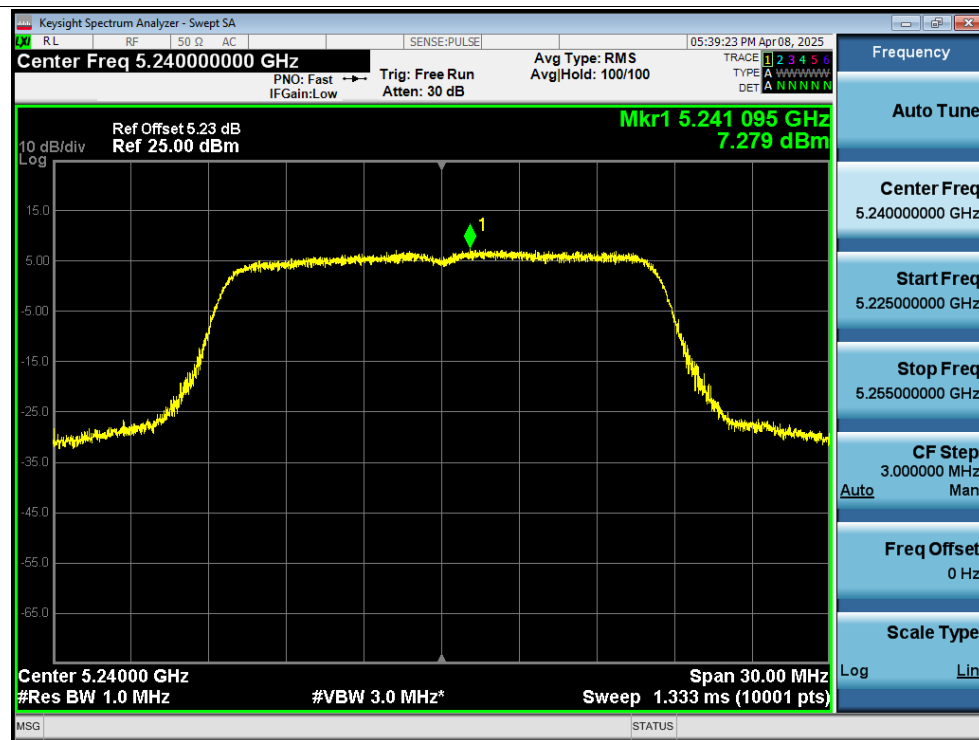


PSD NVNT a 5240MHz Ant3

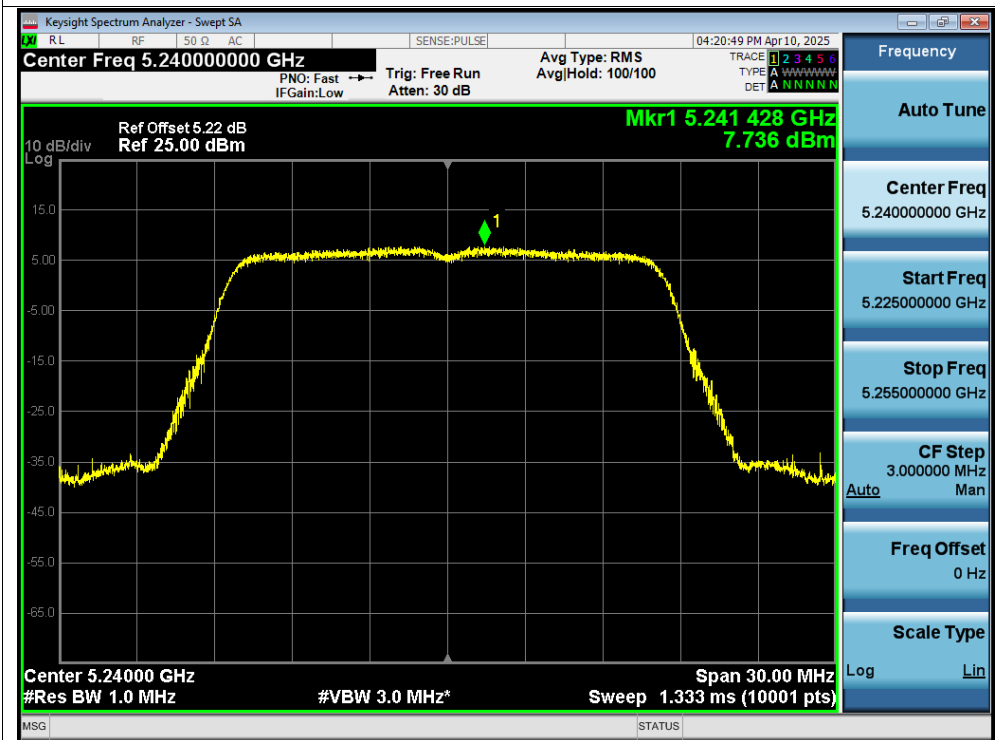


PSD NVNT a 5260MHz Ant1

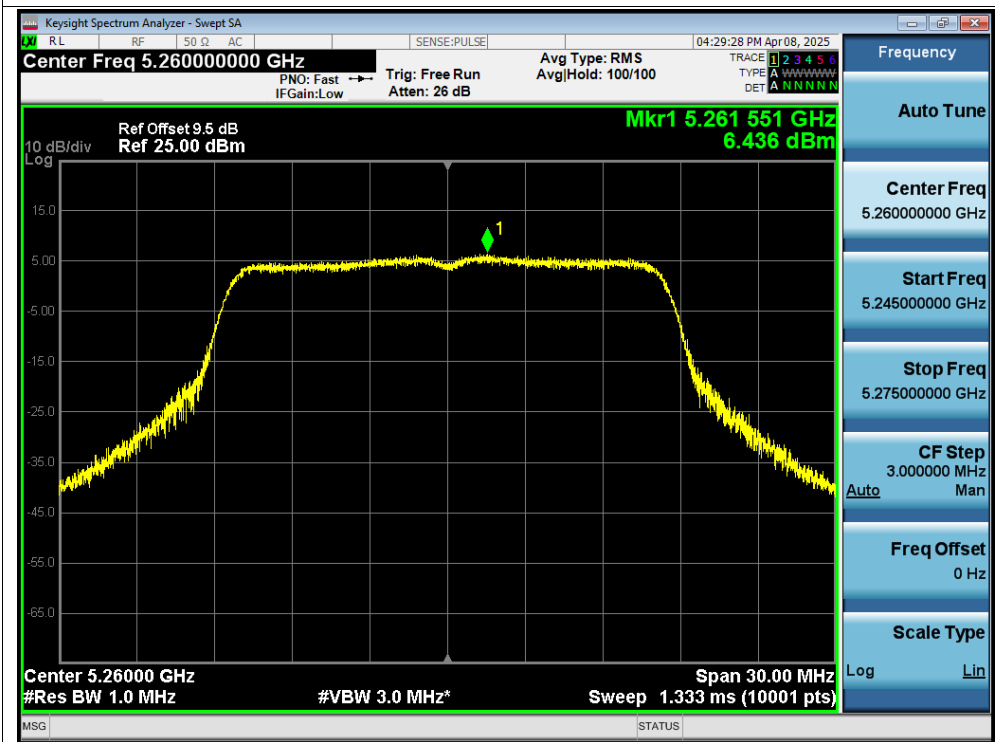


PSD NVNT a 5260MHz Ant2

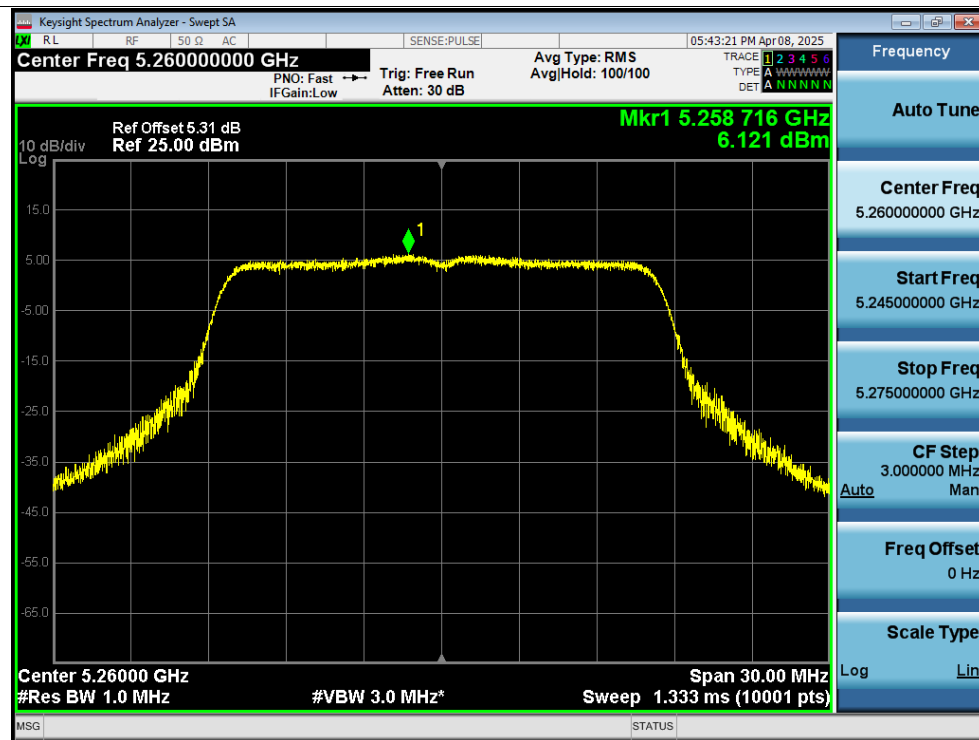


PSD NVNT a 5260MHz Ant3

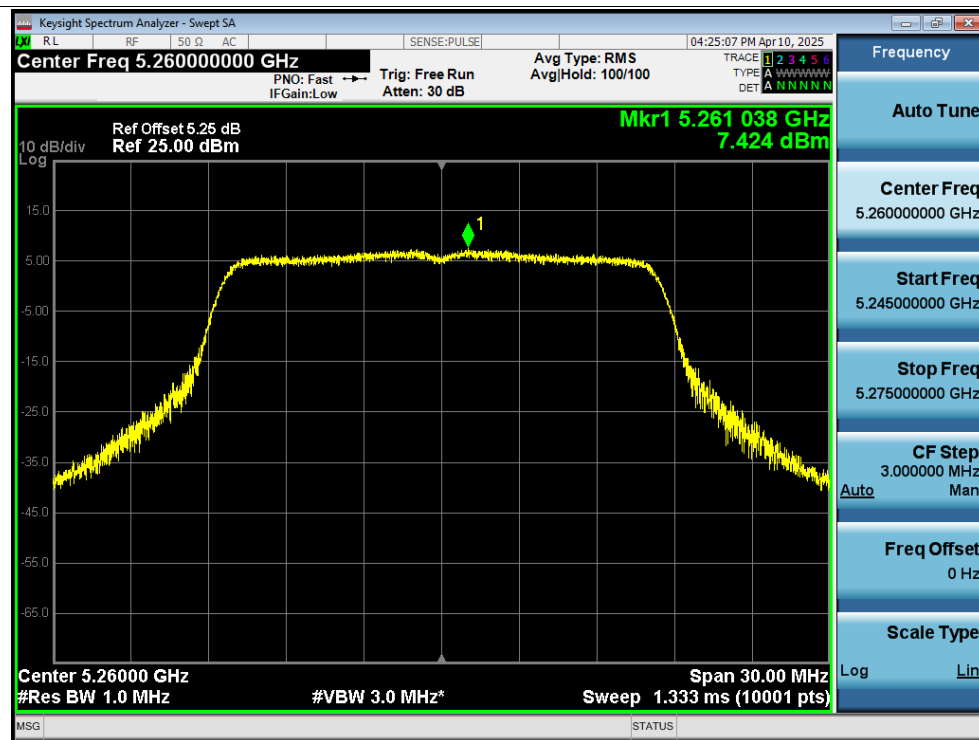


PSD NVNT a 5280MHz Ant1

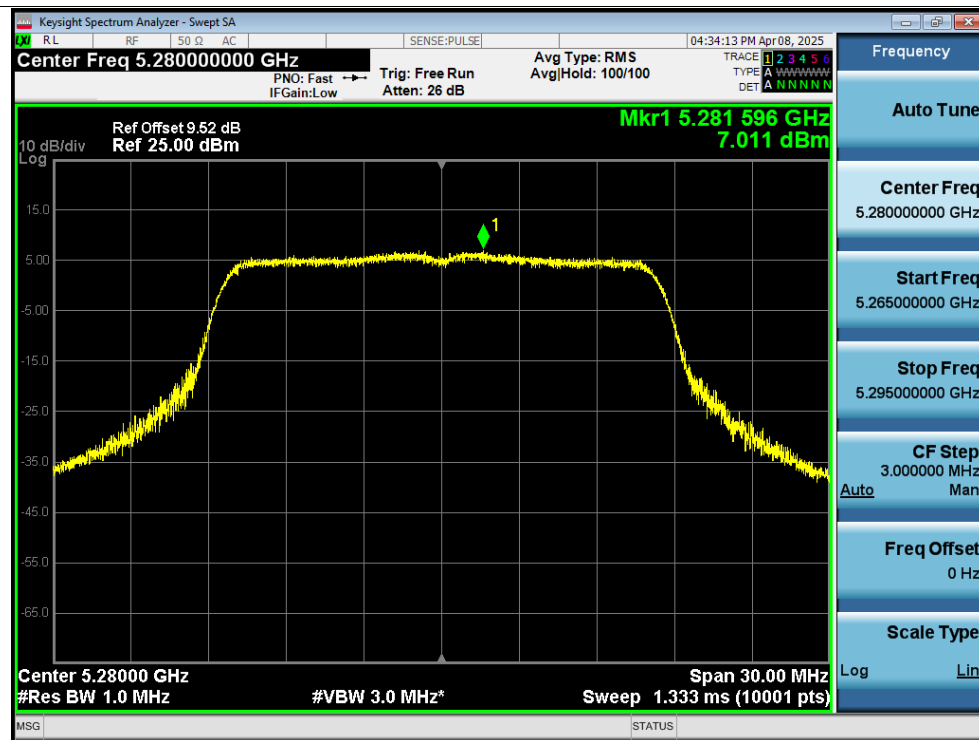


PSD NVNT a 5280MHz Ant2

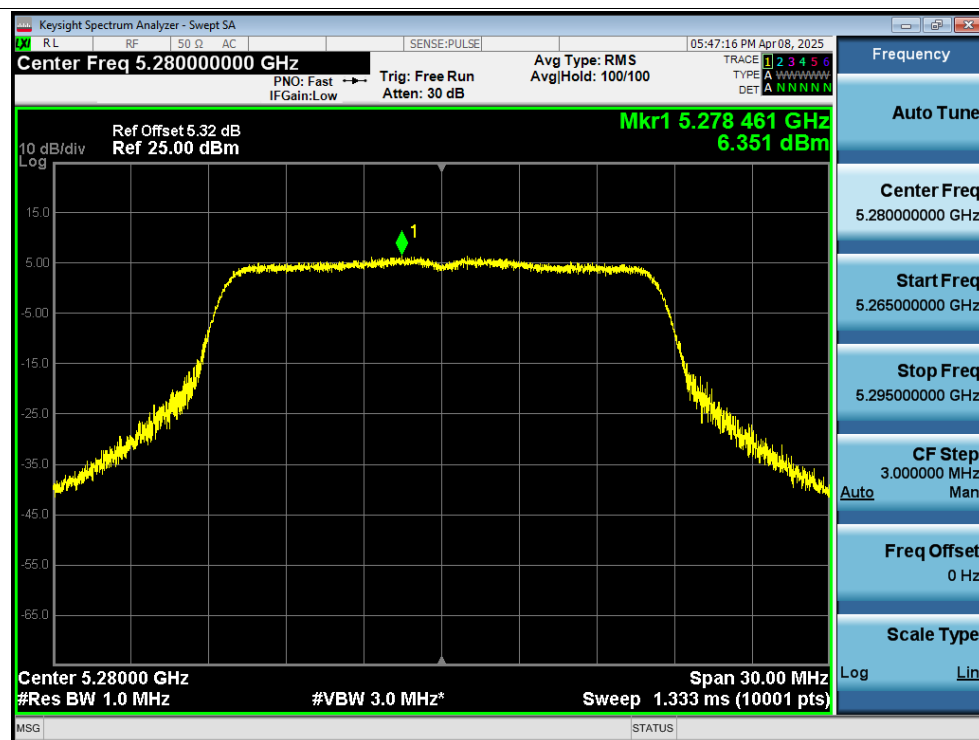

PSD NVNT a 5280MHz Ant3

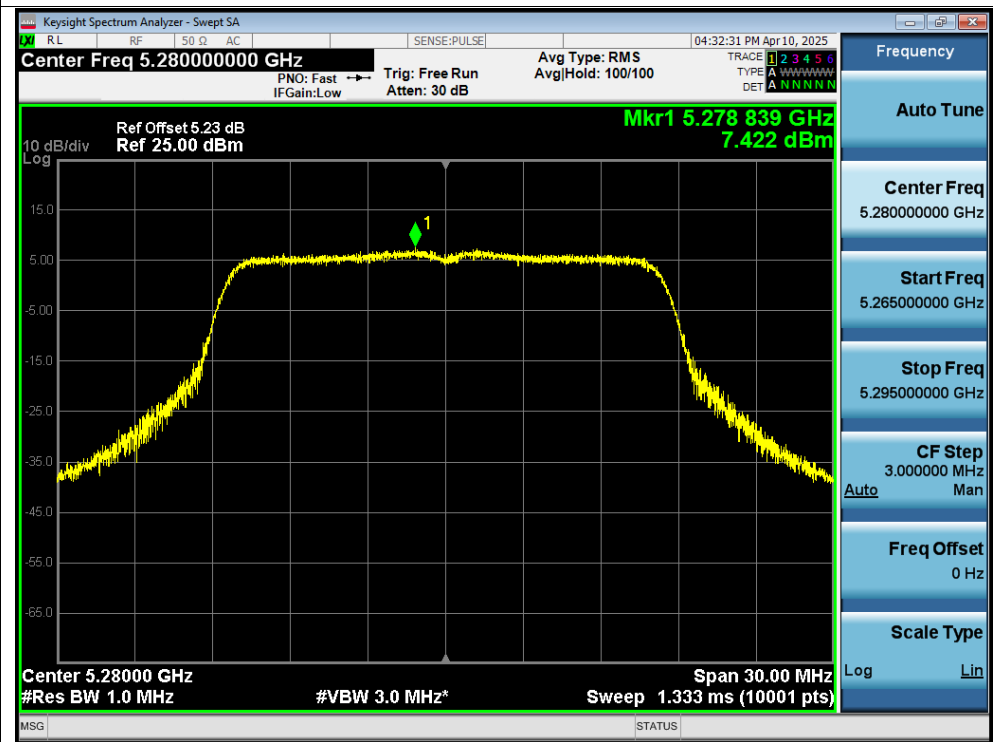


PSD NVNT a 5320MHz Ant1

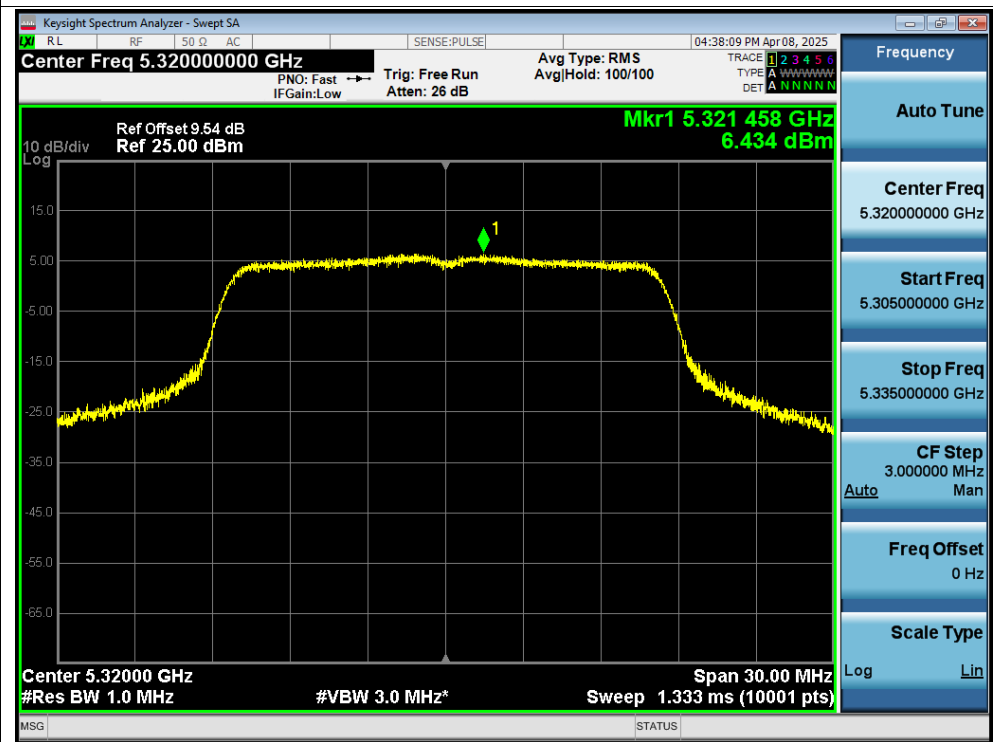


PSD NVNT a 5320MHz Ant2




PSD NVNT a 5320MHz Ant3

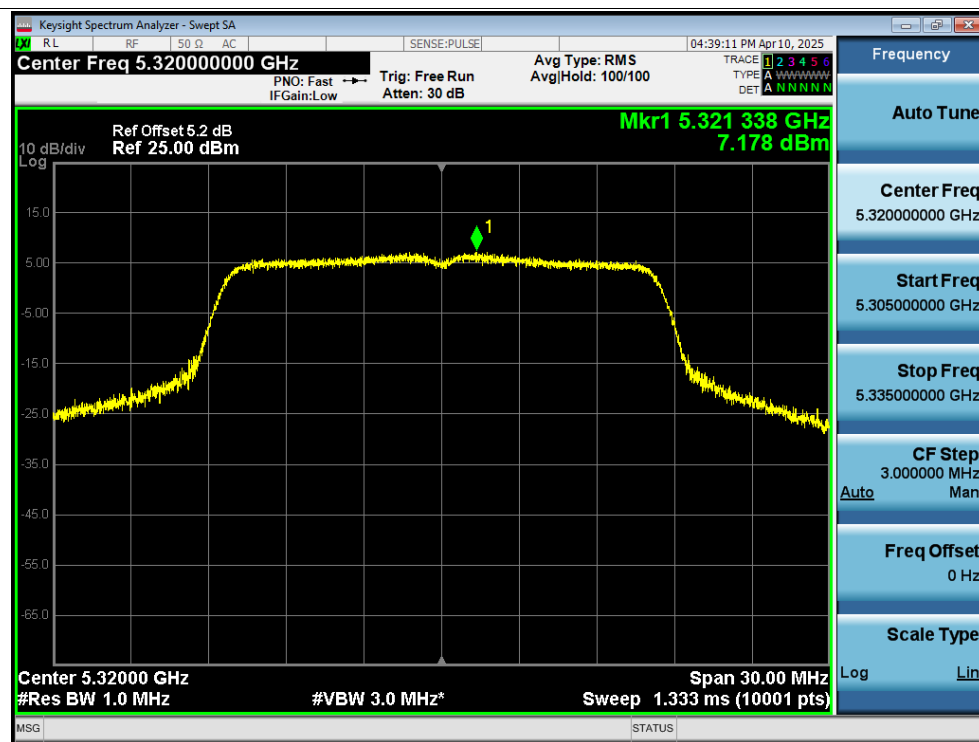


PSD NVNT a 5500MHz Ant1

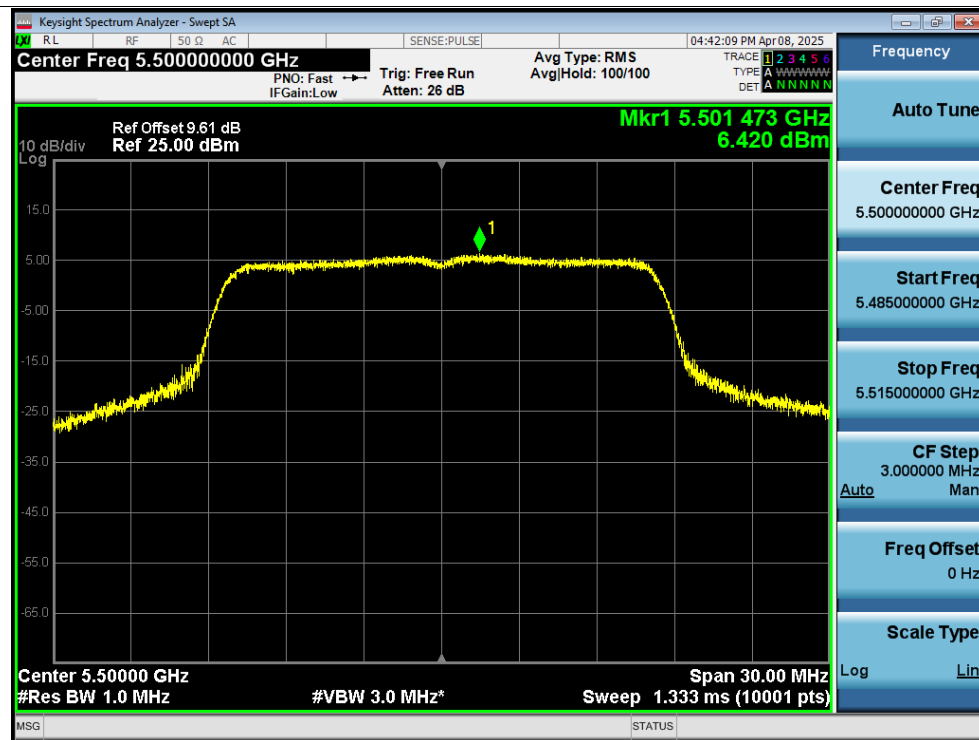


PSD NVNT a 5500MHz Ant2

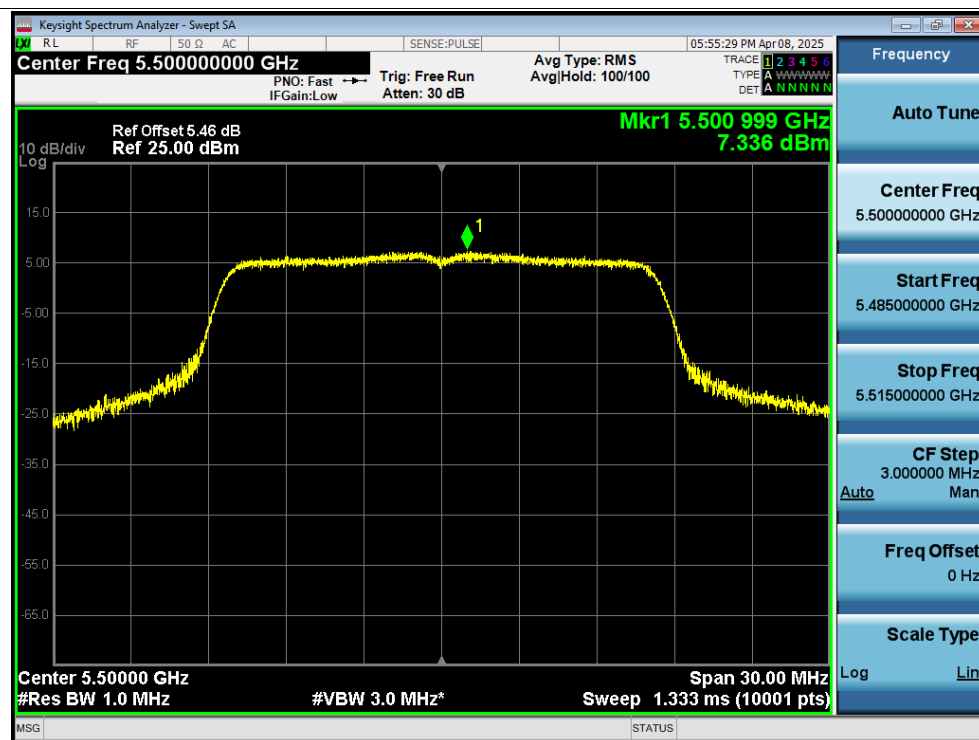


PSD NVNT a 5500MHz Ant3

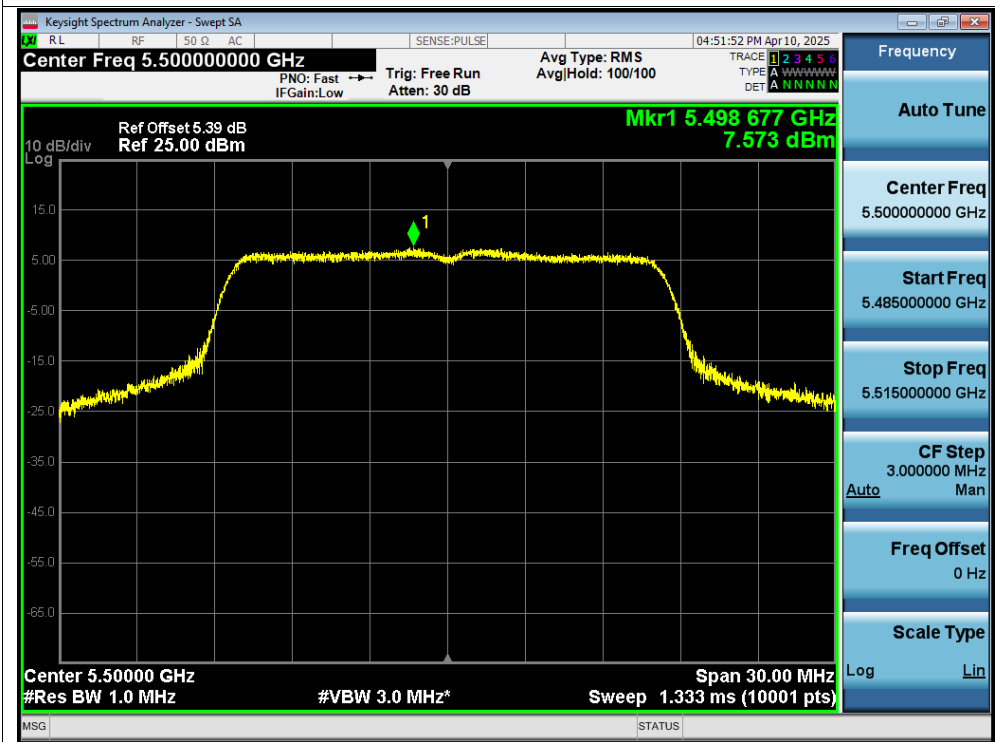


PSD NVNT a 5600MHz Ant1

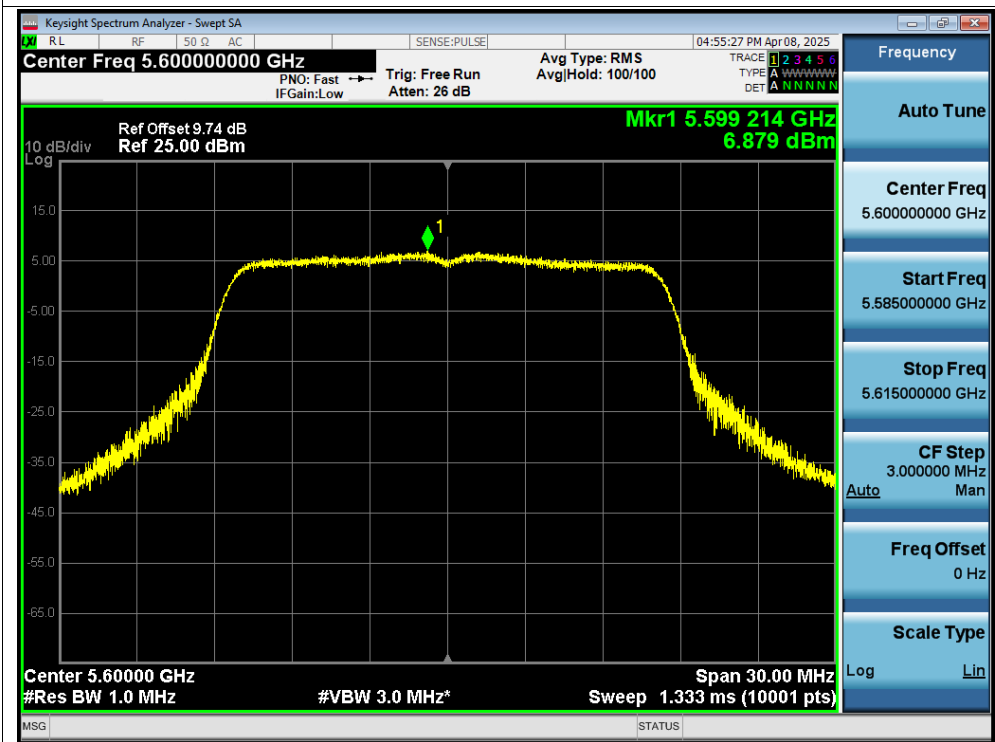


PSD NVNT a 5600MHz Ant2

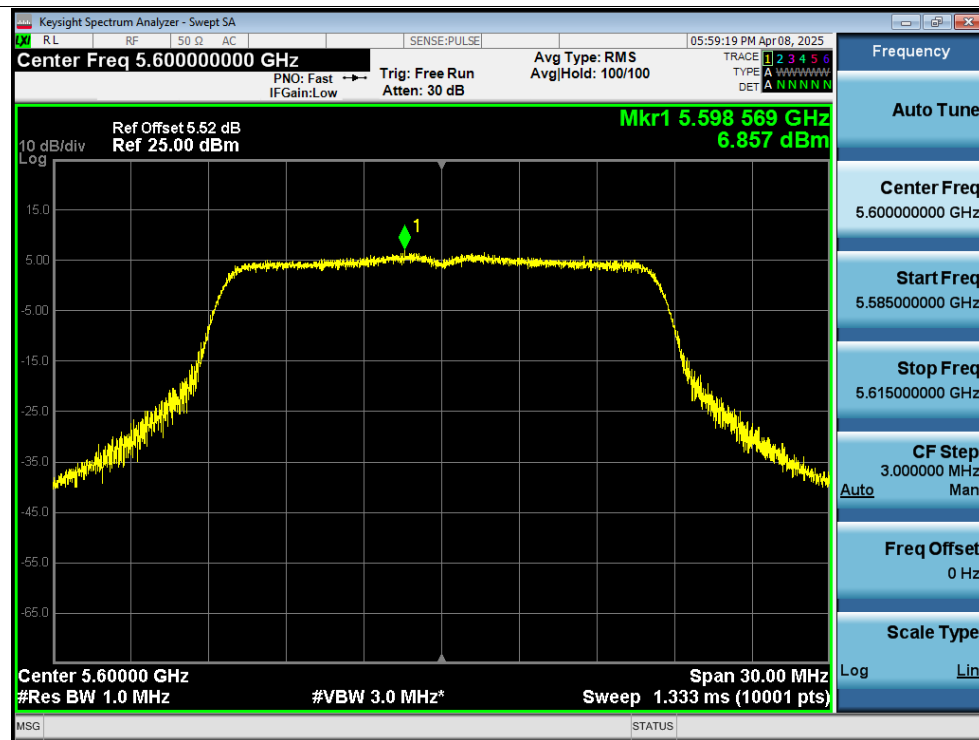


PSD NVNT a 5600MHz Ant3

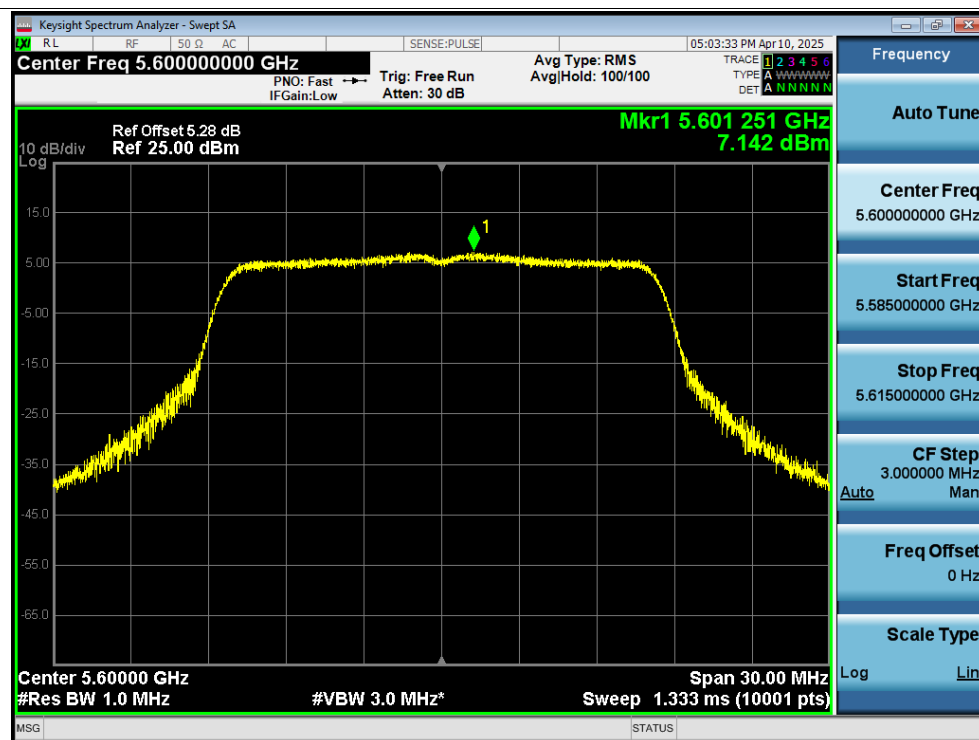


PSD NVNT a 5700MHz Ant1

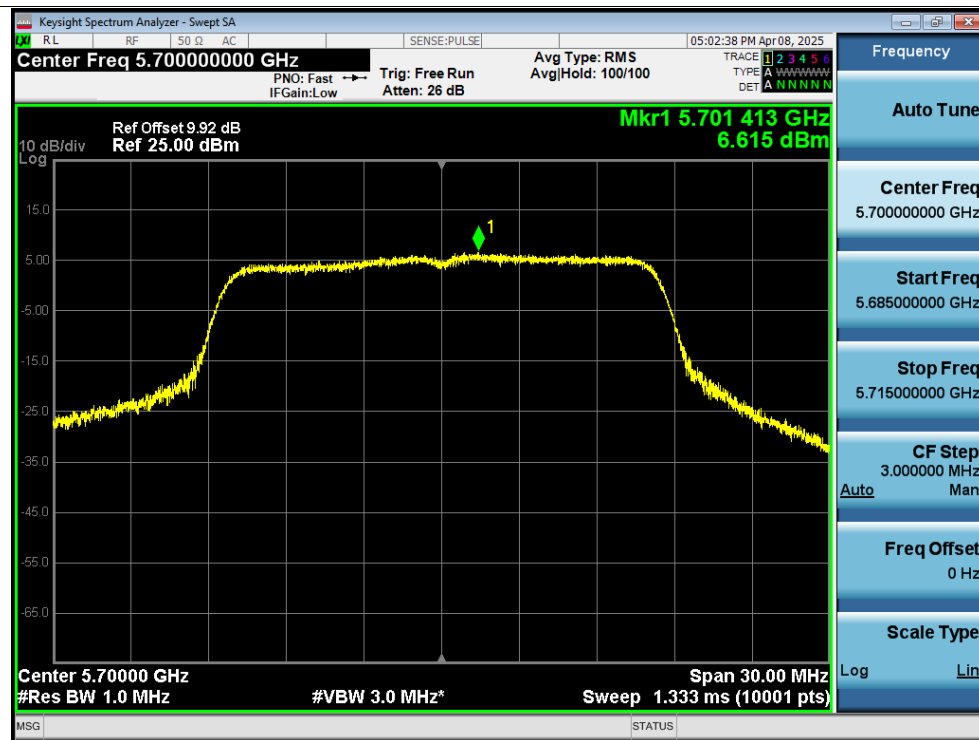

PSD NVNT a 5700MHz Ant2

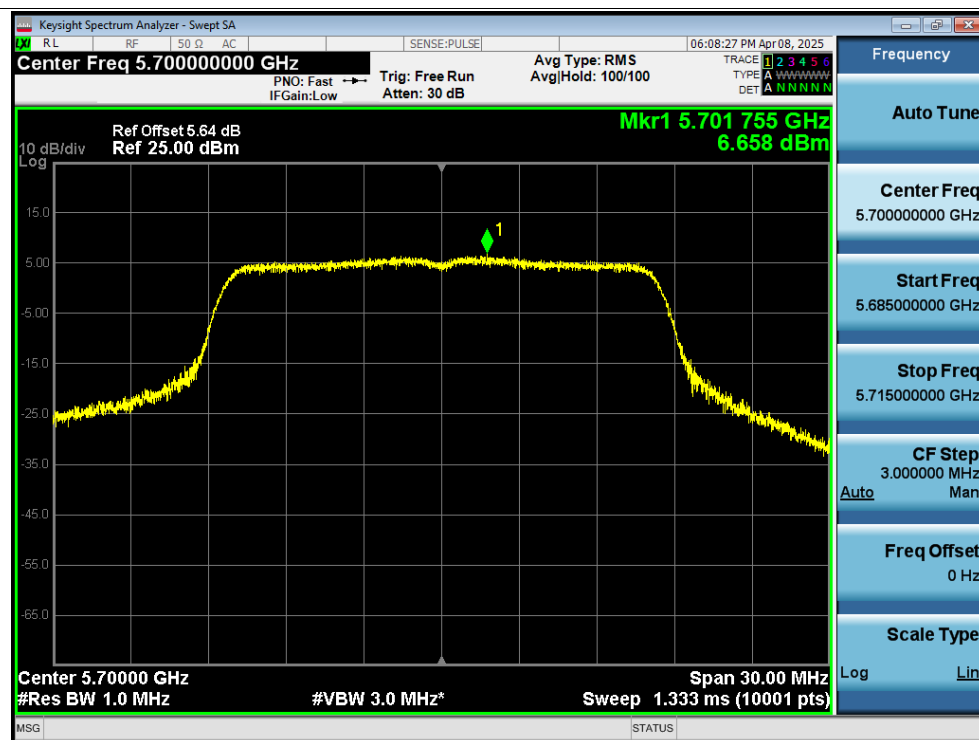

PSD NVNT a 5700MHz Ant3

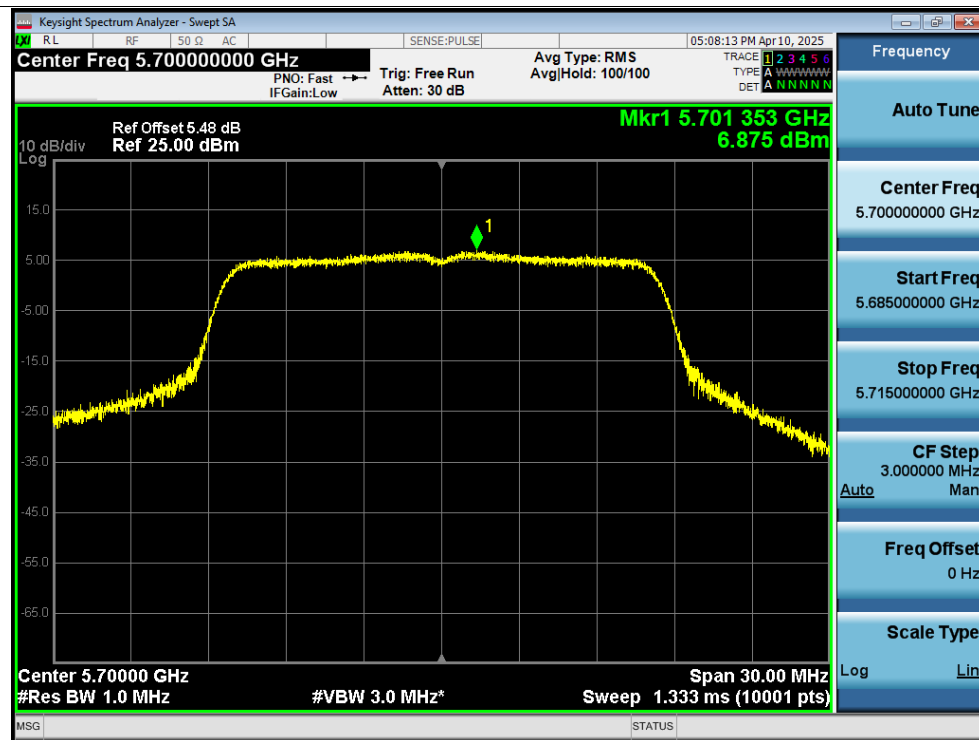


PSD NVNT a 5745MHz Ant1



PSD NVNT a 5745MHz Ant2




PSD NVNT a 5745MHz Ant3

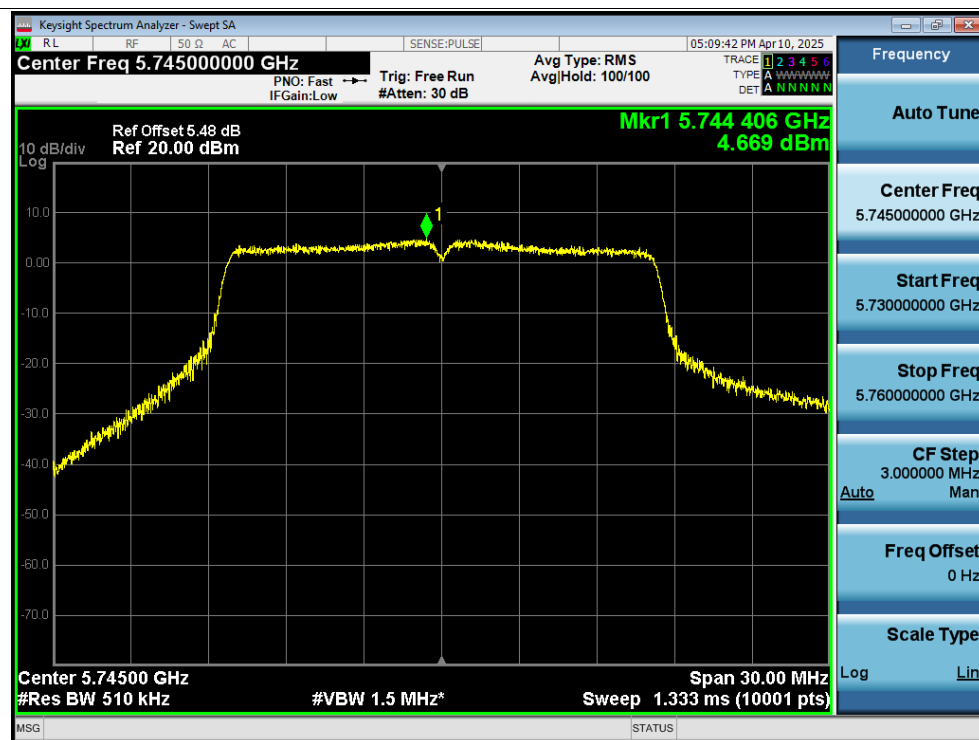

PSD NVNT a 5785MHz Ant1




PSD NVNT a 5785MHz Ant2

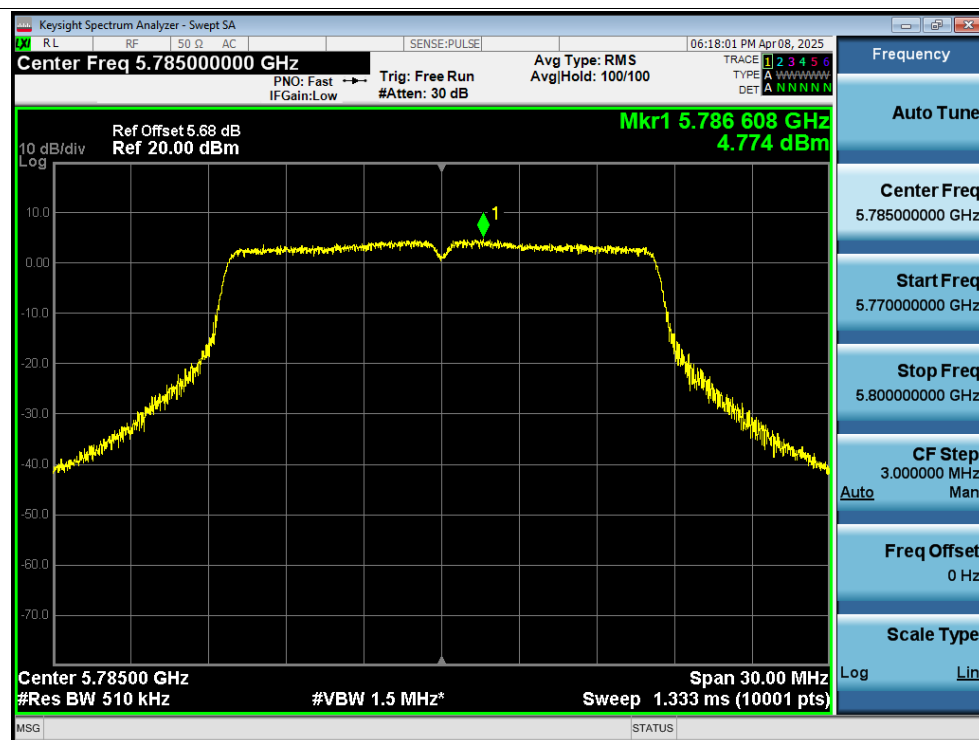


PSD NVNT a 5785MHz Ant3



PSD NVNT a 5825MHz Ant1

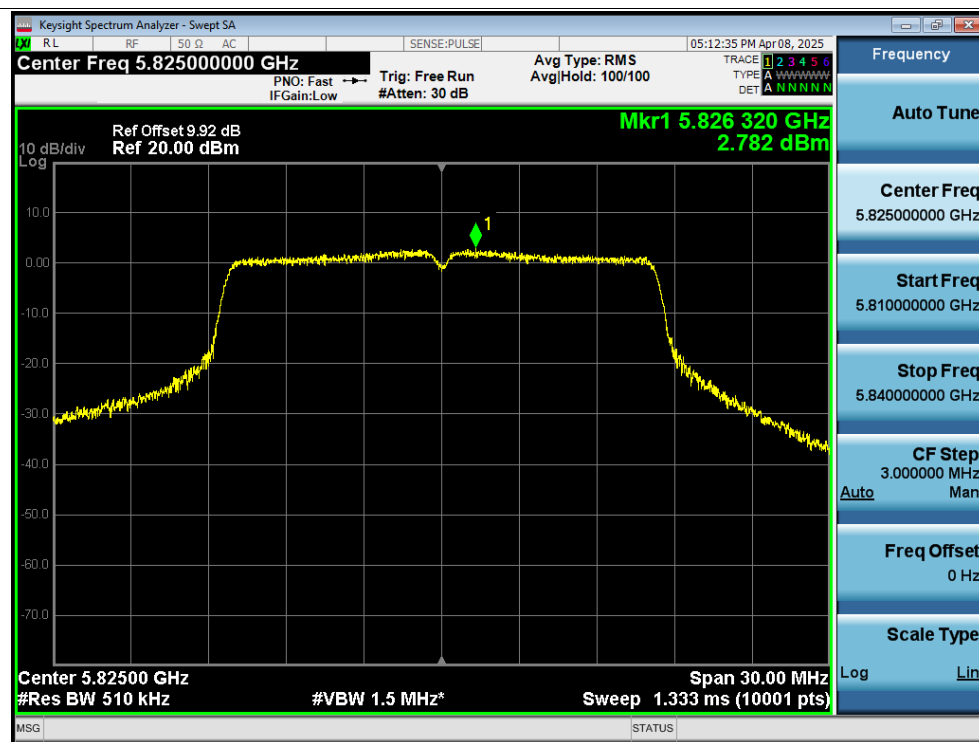


PSD NVNT a 5825MHz Ant2

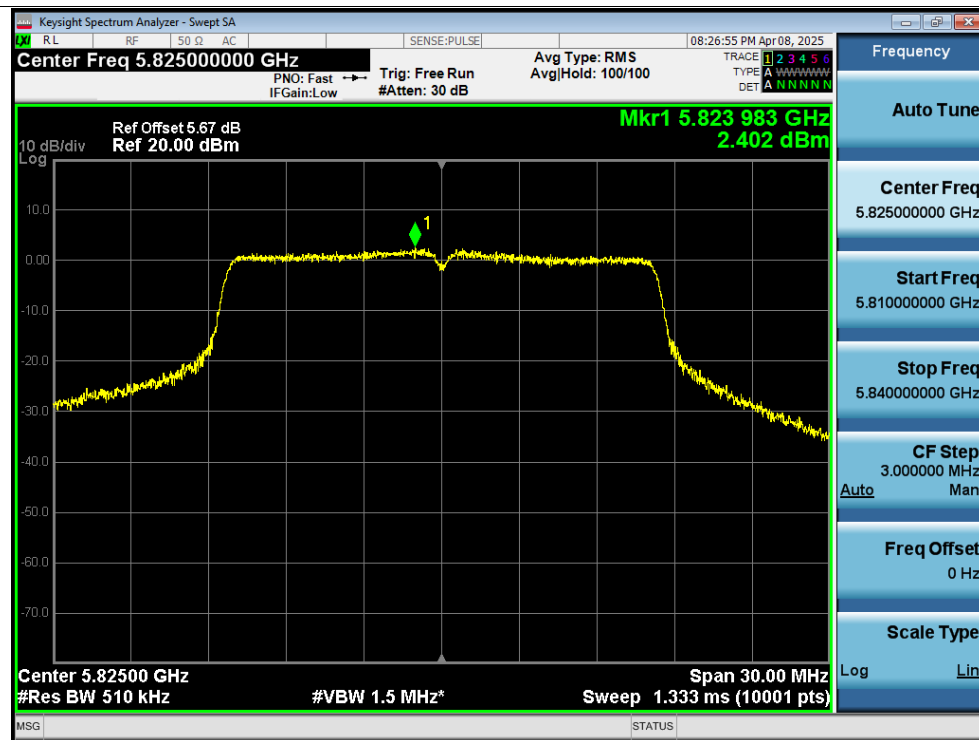

PSD NVNT a 5825MHz Ant3




PSD NVNT n20 5180MHz Ant1

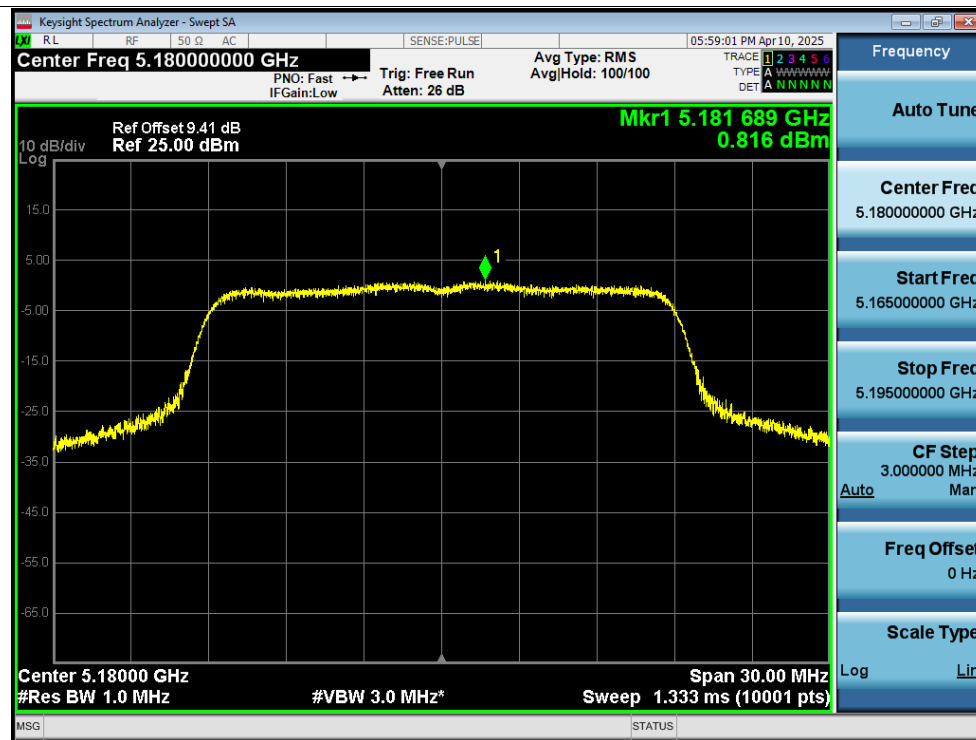


PSD NVNT n20 5180MHz Ant2




PSD NVNT n20 5180MHz Ant3

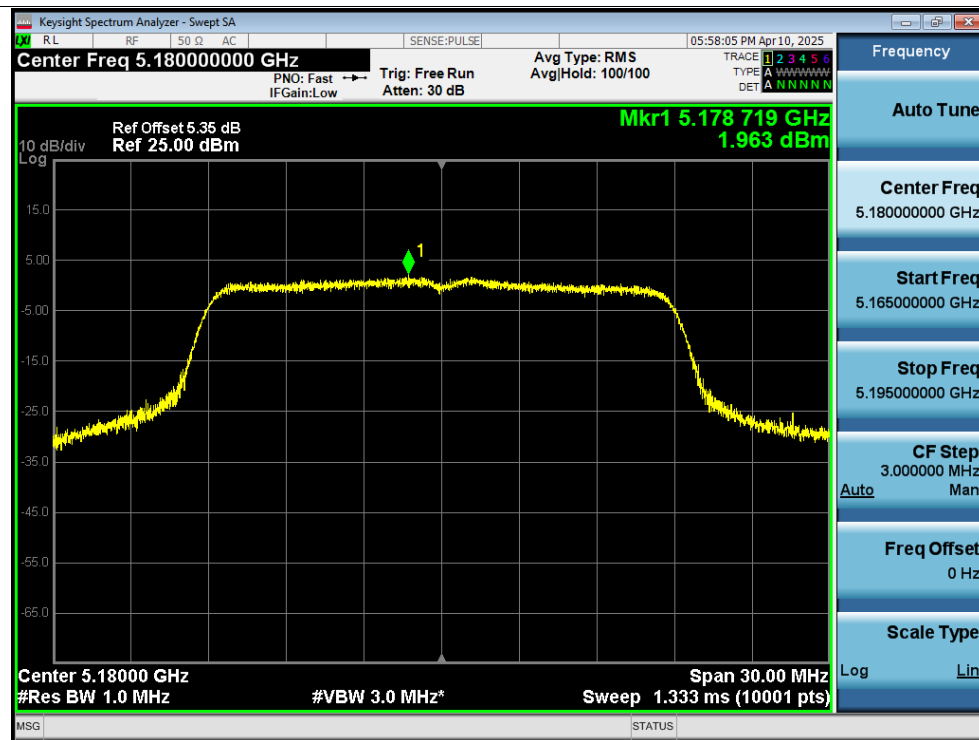


PSD NVNT n20 5200MHz Ant1

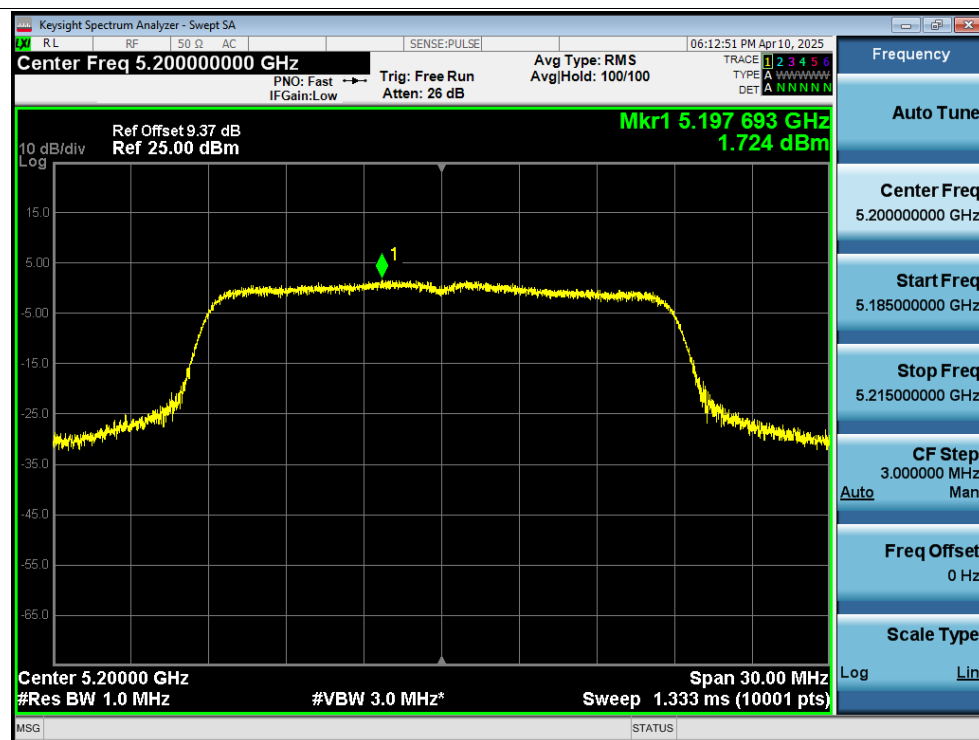


PSD NVNT n20 5200MHz Ant2

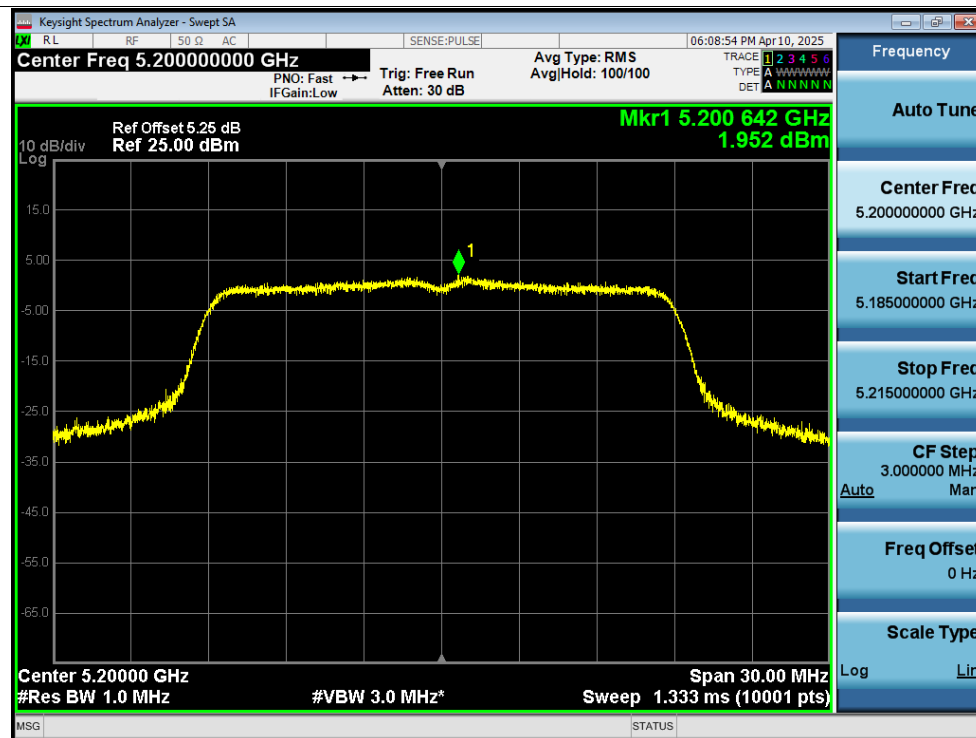


PSD NVNT n20 5200MHz Ant3

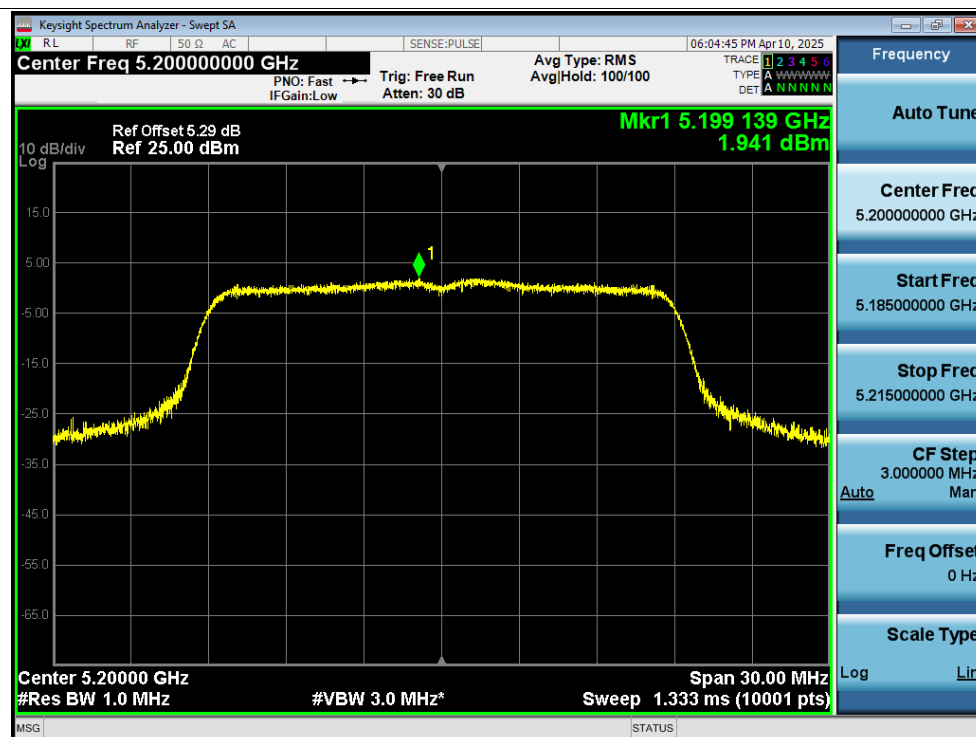


PSD NVNT n20 5240MHz Ant1

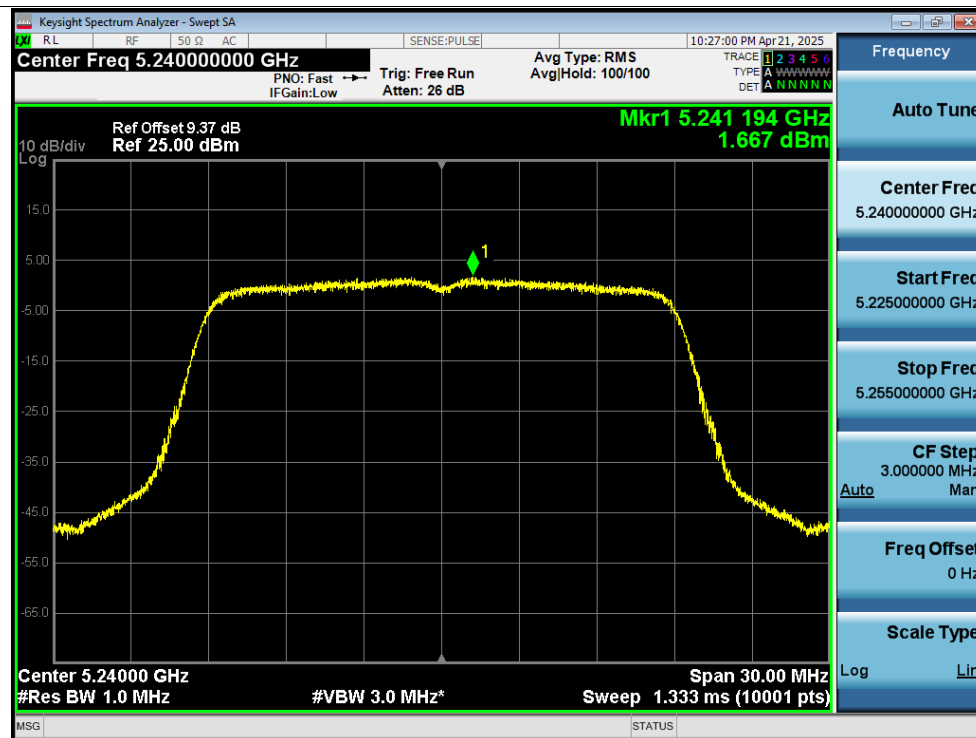


PSD NVNT n20 5240MHz Ant2

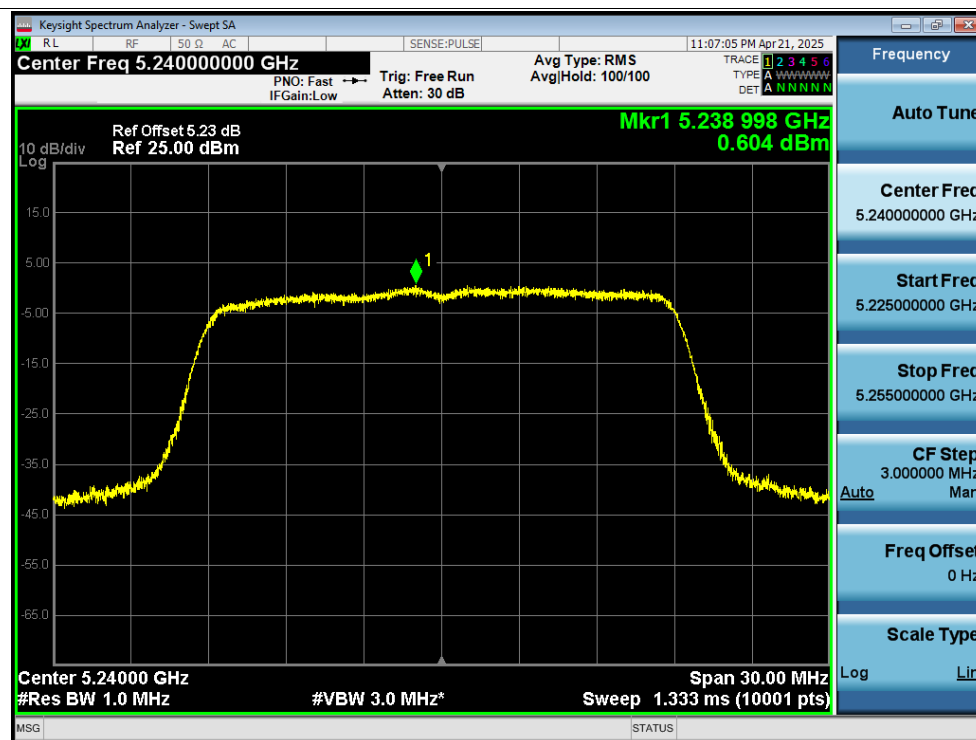


PSD NVNT n20 5240MHz Ant3

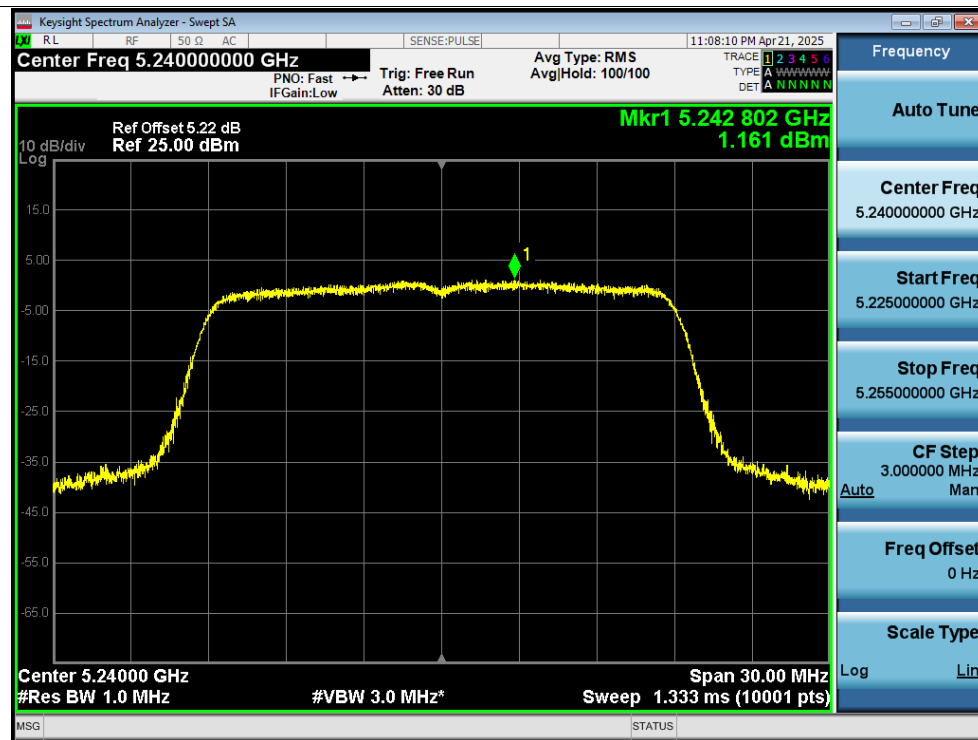


PSD NVNT n20 5260MHz Ant1

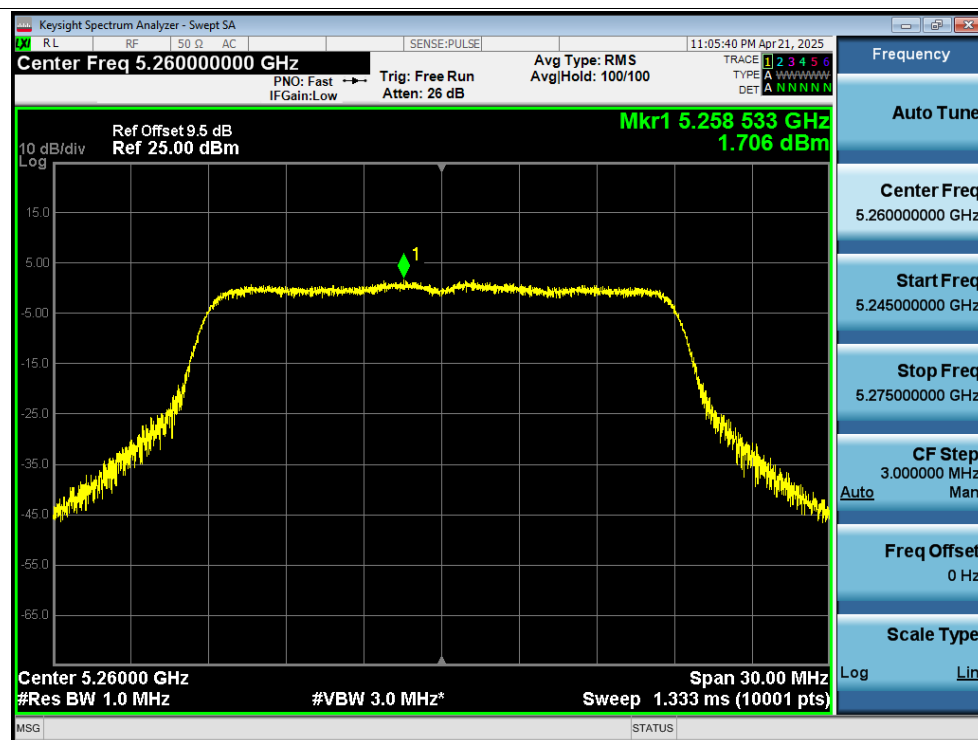


PSD NVNT n20 5260MHz Ant2

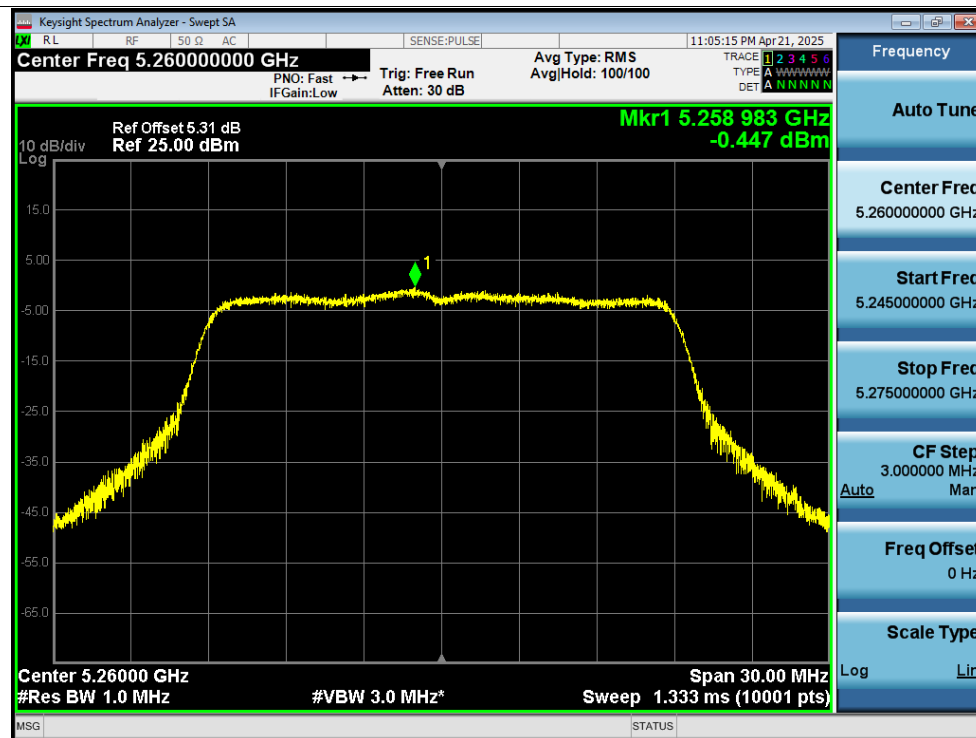


PSD NVNT n20 5260MHz Ant3

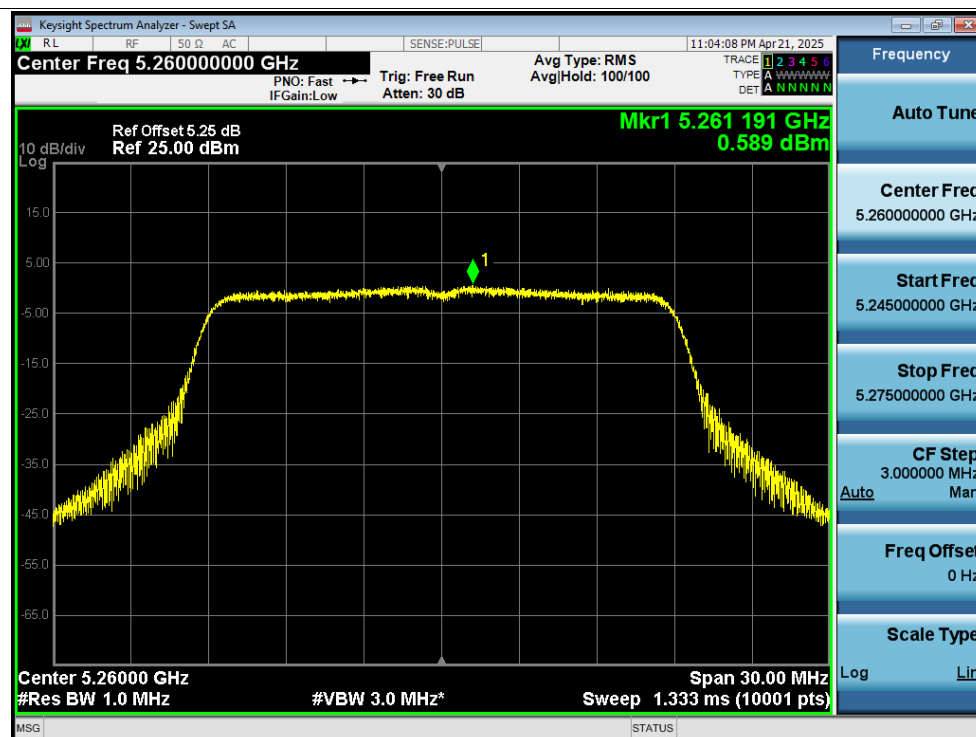


PSD NVNT n20 5280MHz Ant1

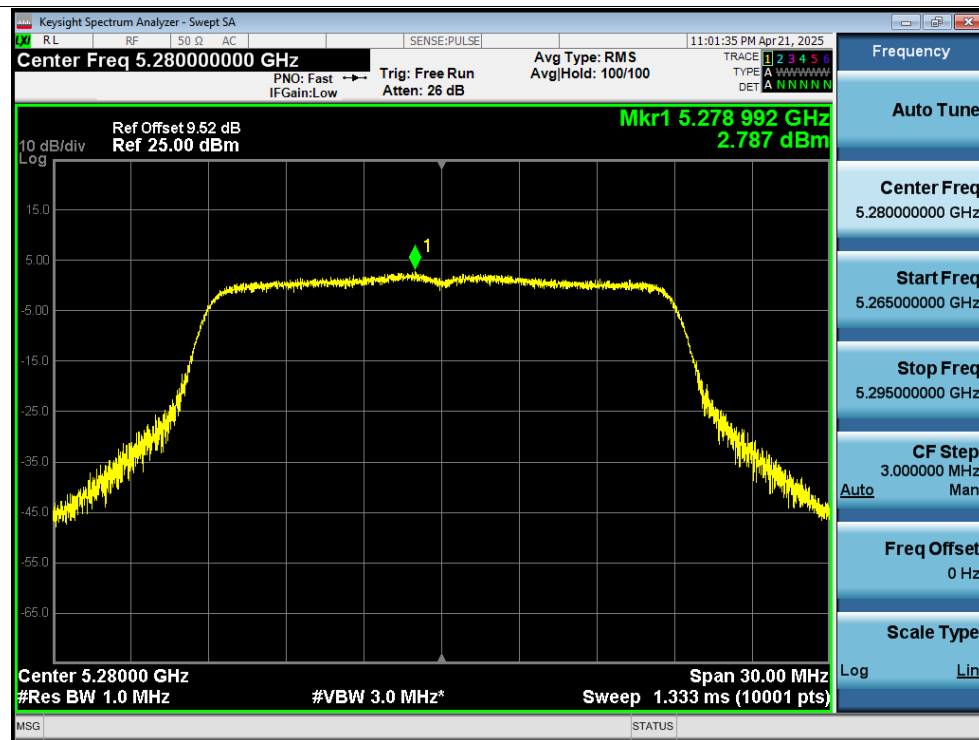


PSD NVNT n20 5280MHz Ant2

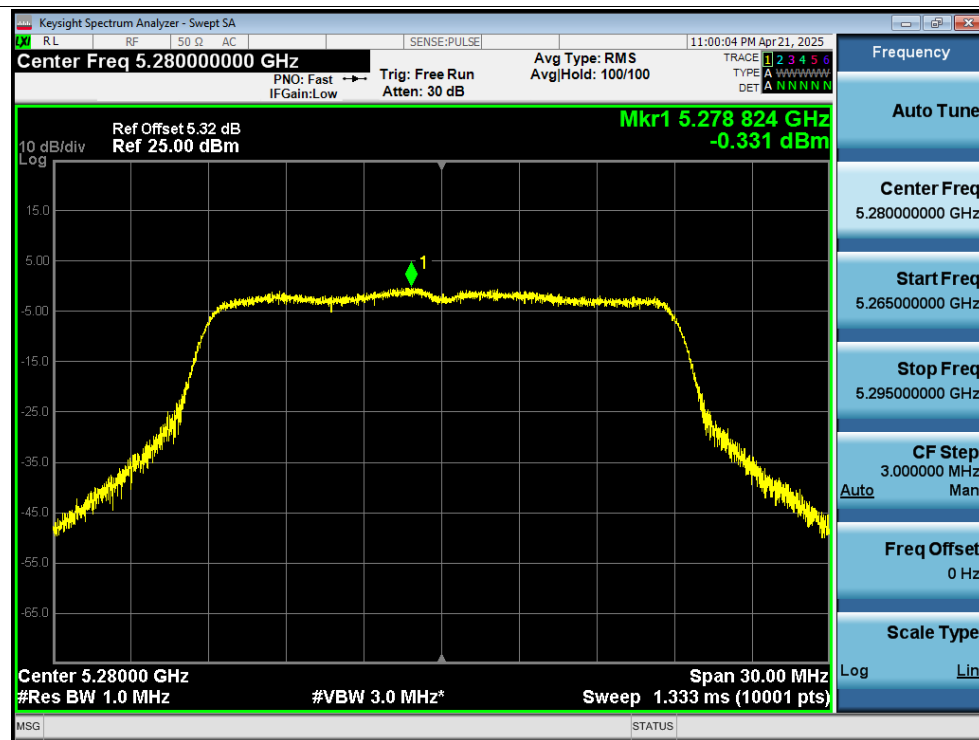


PSD NVNT n20 5280MHz Ant3

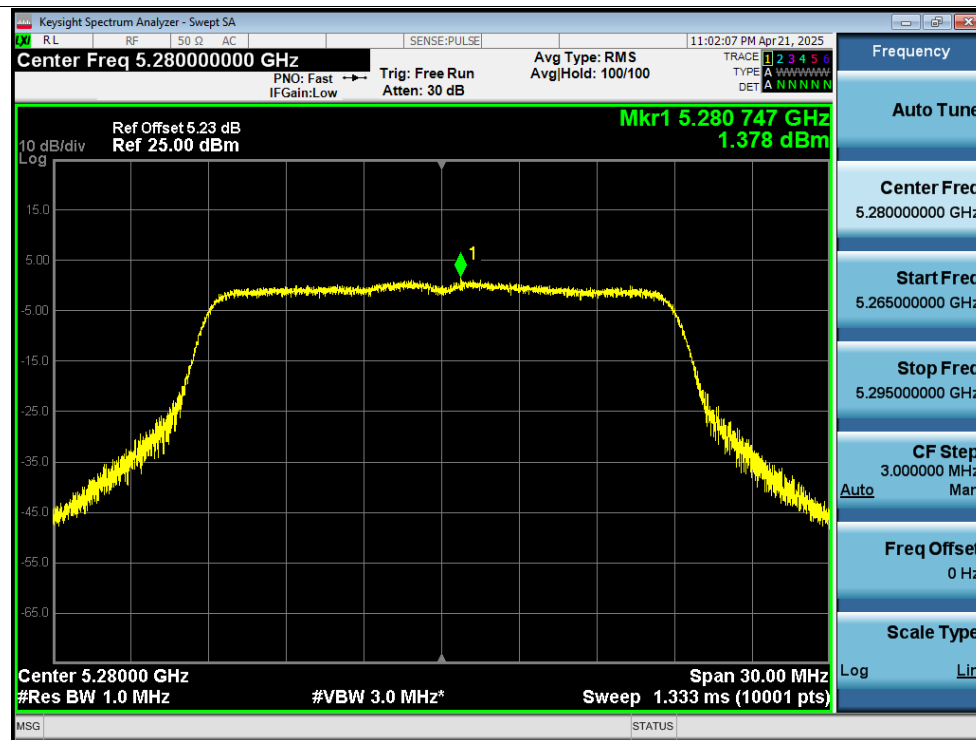


PSD NVNT n20 5320MHz Ant1

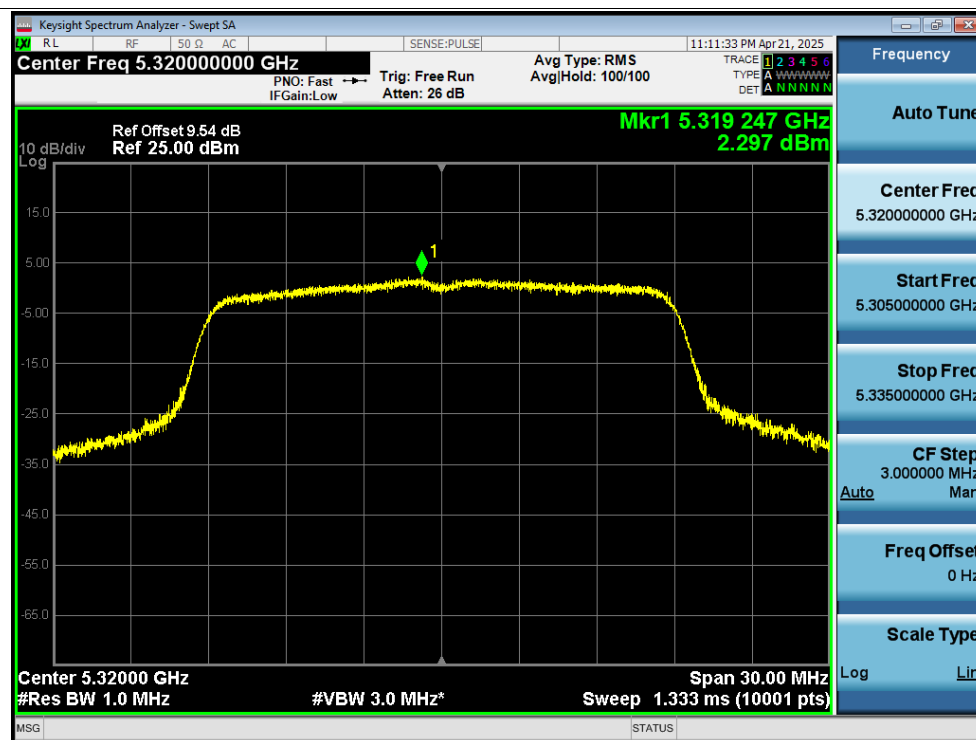


PSD NVNT n20 5320MHz Ant2

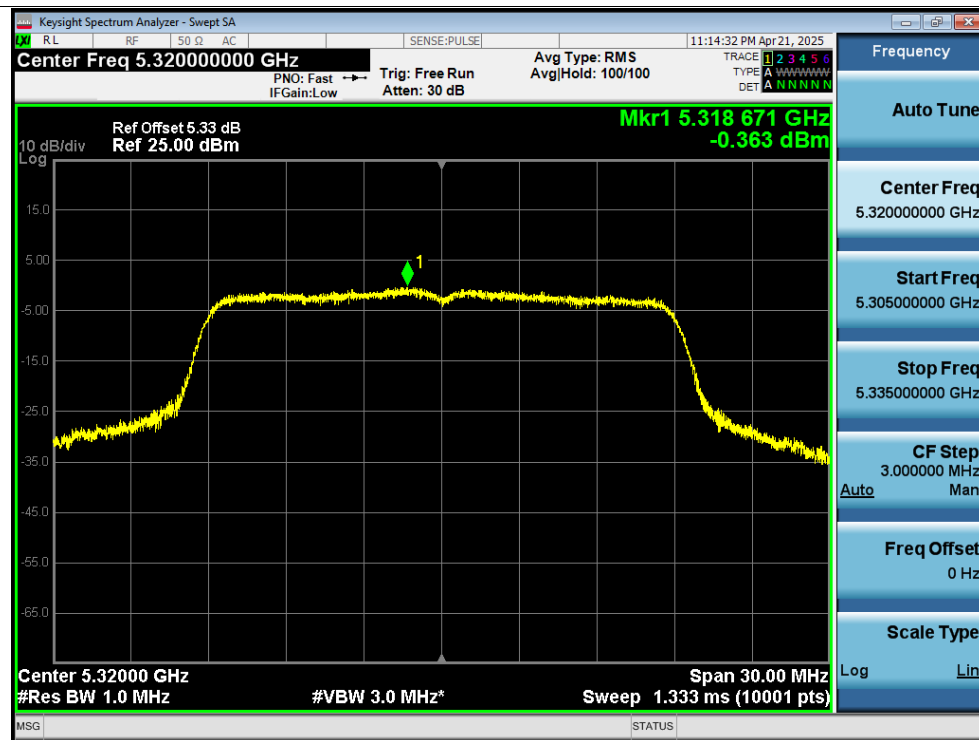


PSD NVNT n20 5320MHz Ant3

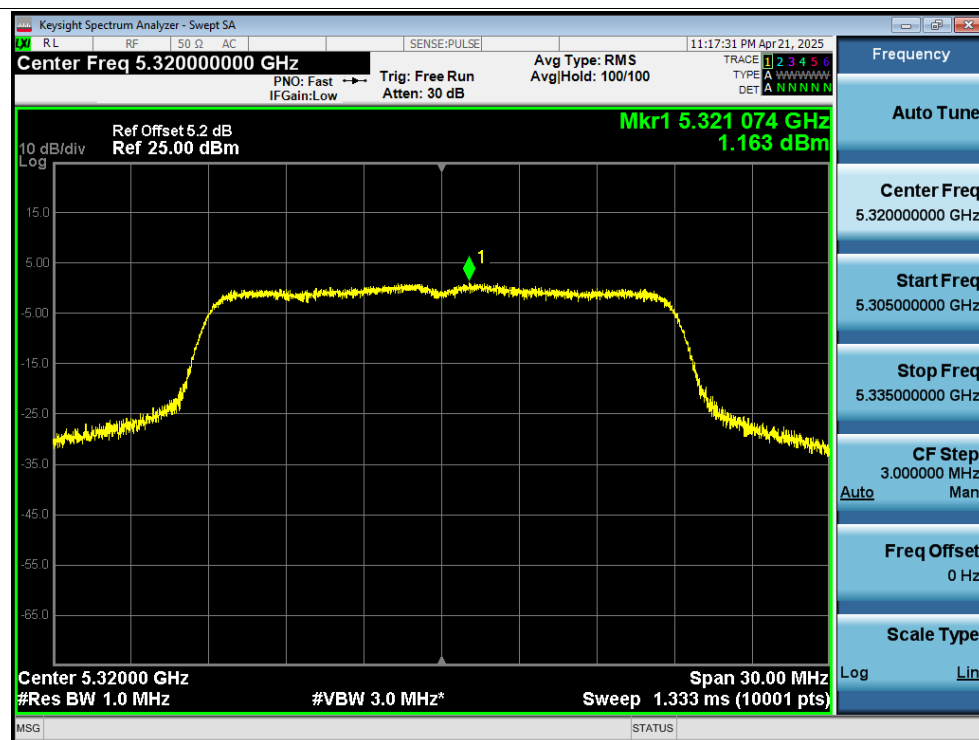


PSD NVNT n20 5500MHz Ant1

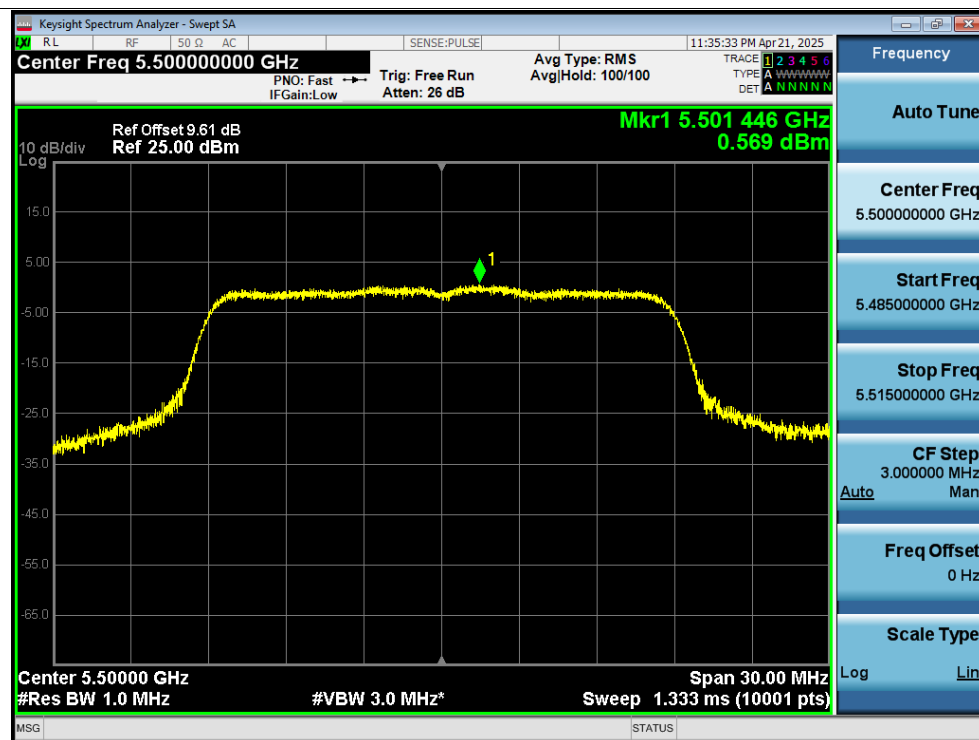


PSD NVNT n20 5500MHz Ant2

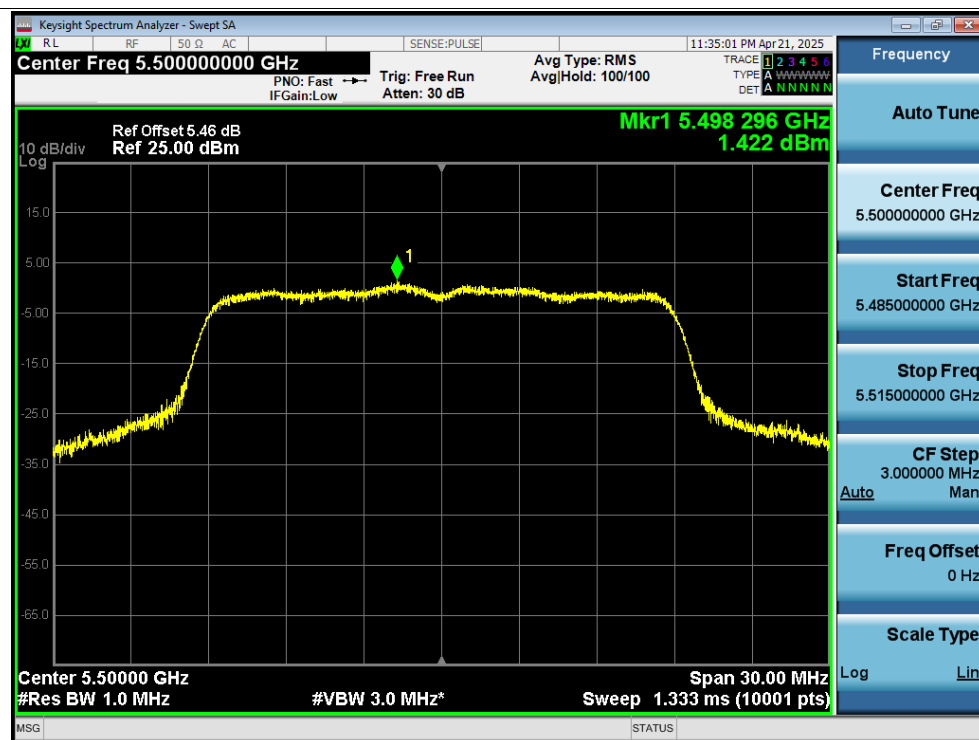


PSD NVNT n20 5500MHz Ant3

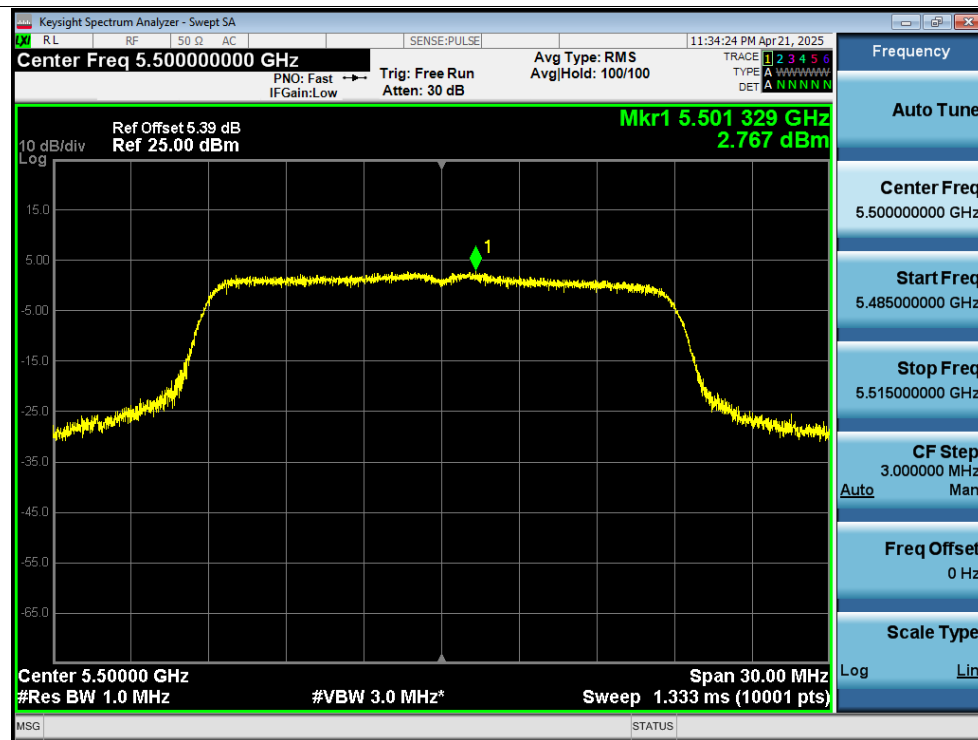


PSD NVNT n20 5600MHz Ant1

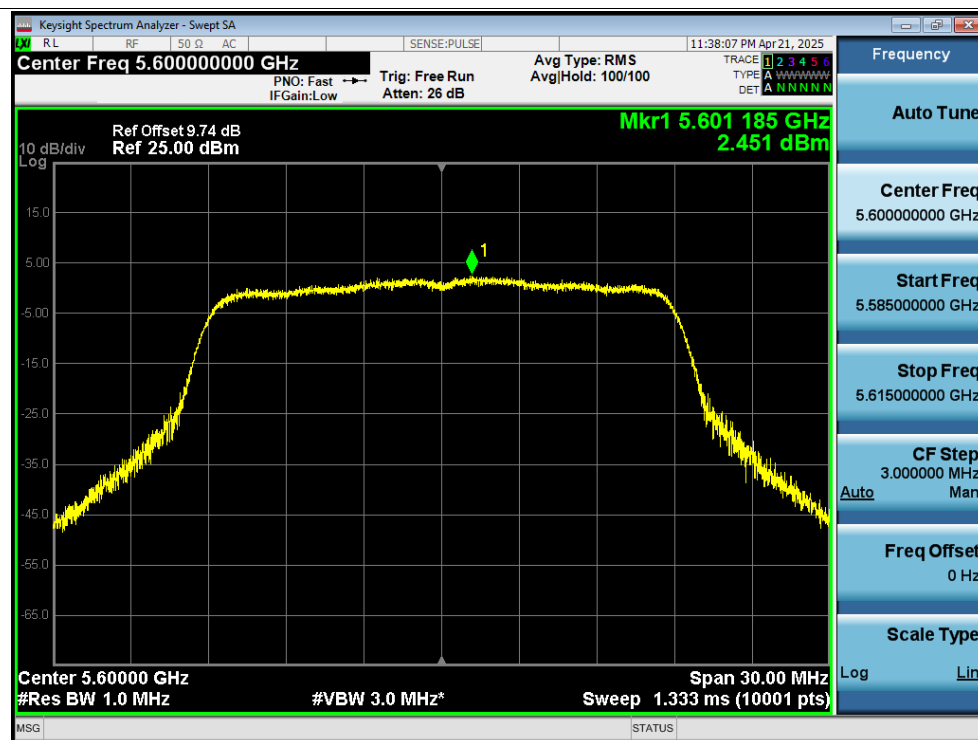


PSD NVNT n20 5600MHz Ant2

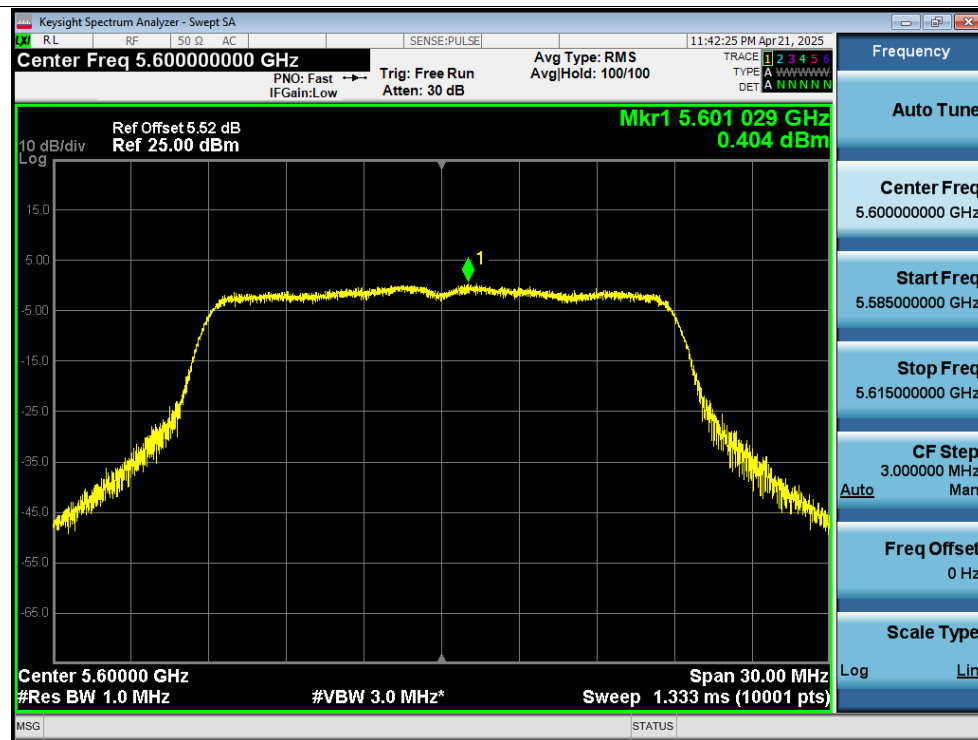


PSD NVNT n20 5600MHz Ant3

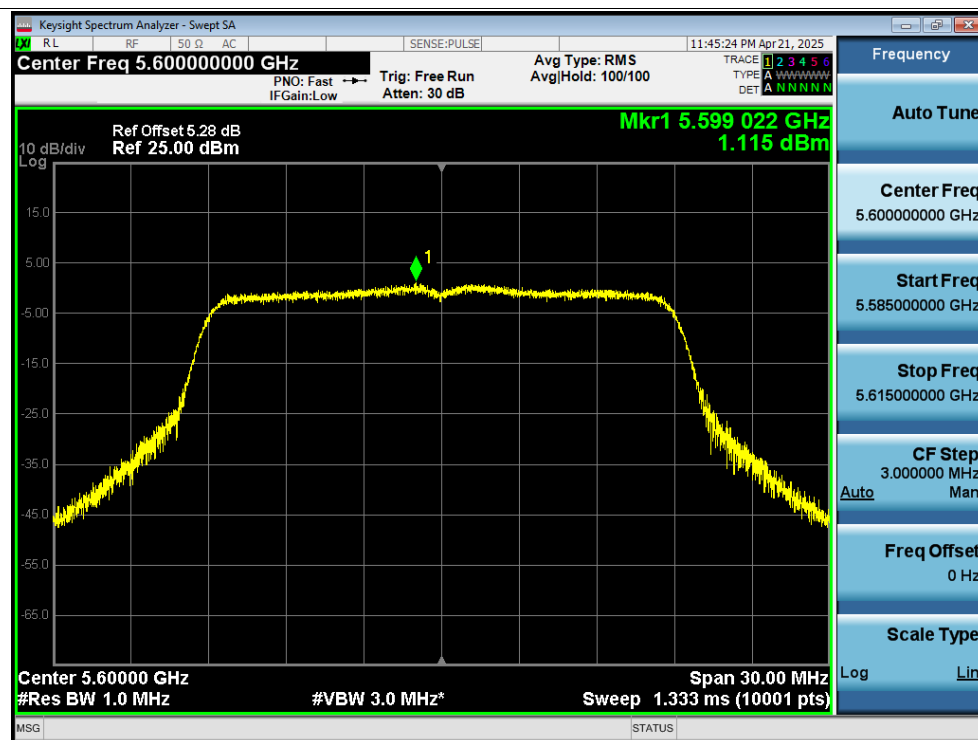


PSD NVNT n20 5700MHz Ant1

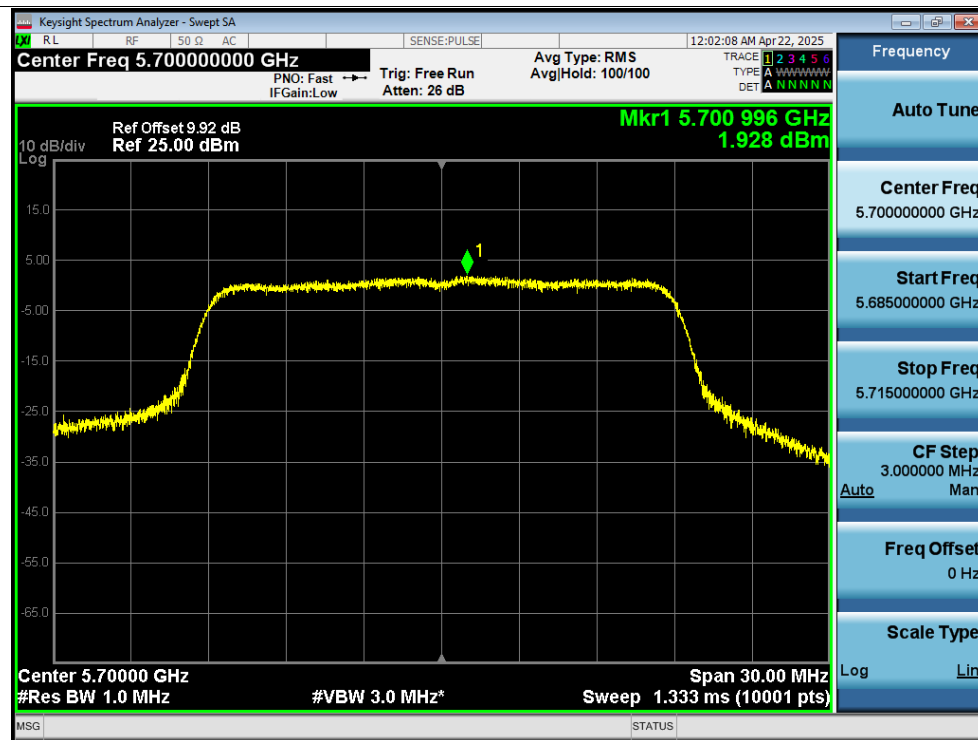


PSD NVNT n20 5700MHz Ant2

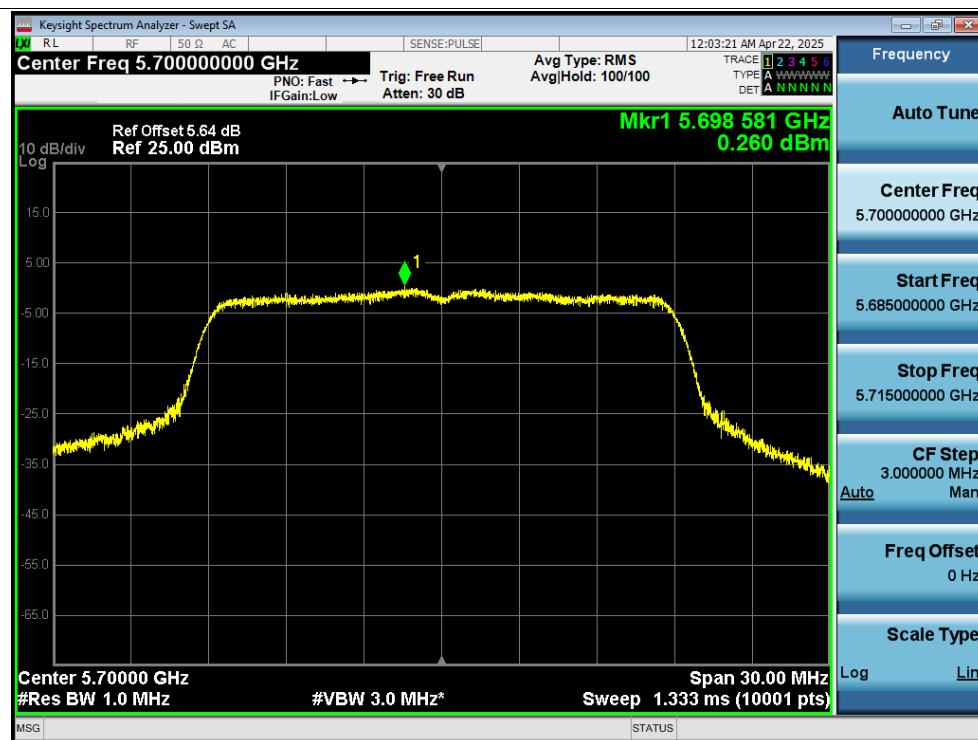


PSD NVNT n20 5700MHz Ant3

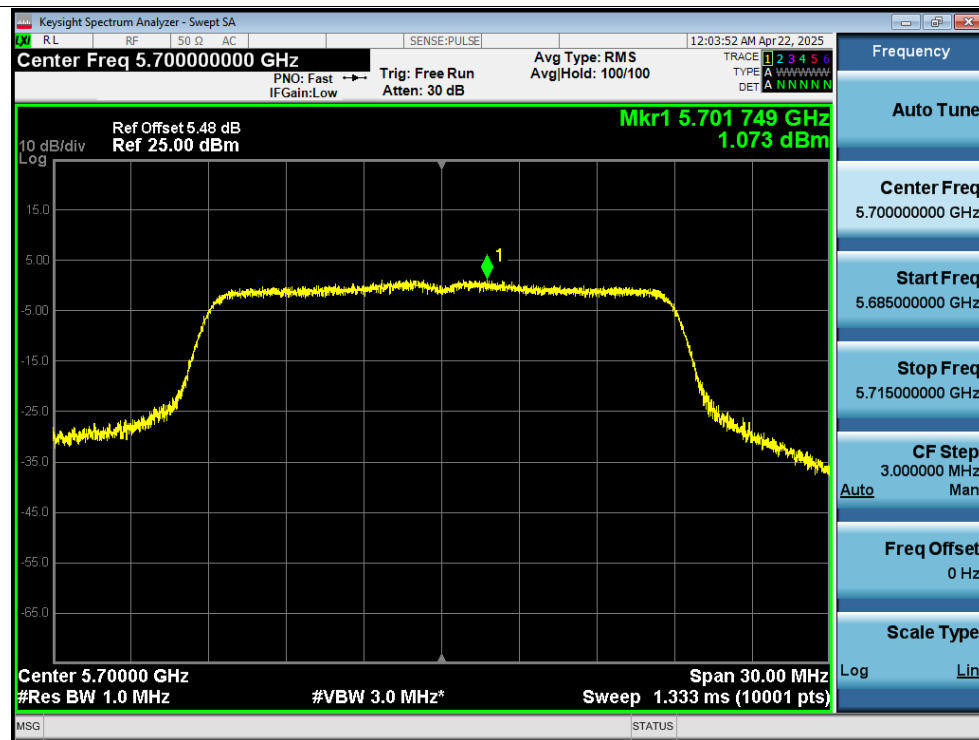

PSD NVNT n20 5745MHz Ant1

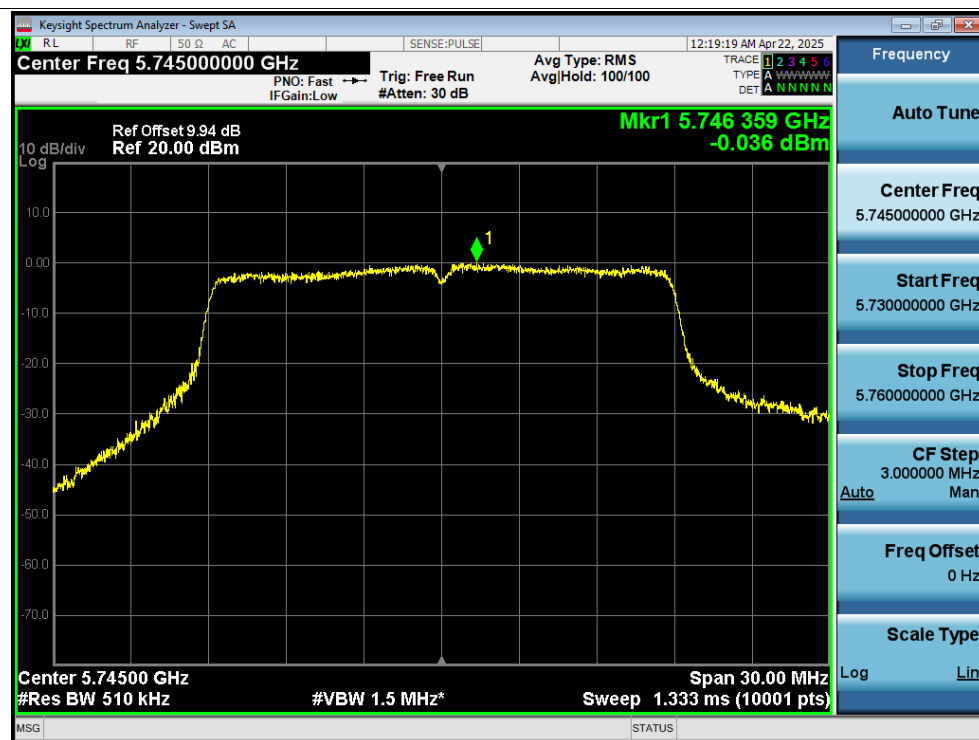

PSD NVNT n20 5745MHz Ant2

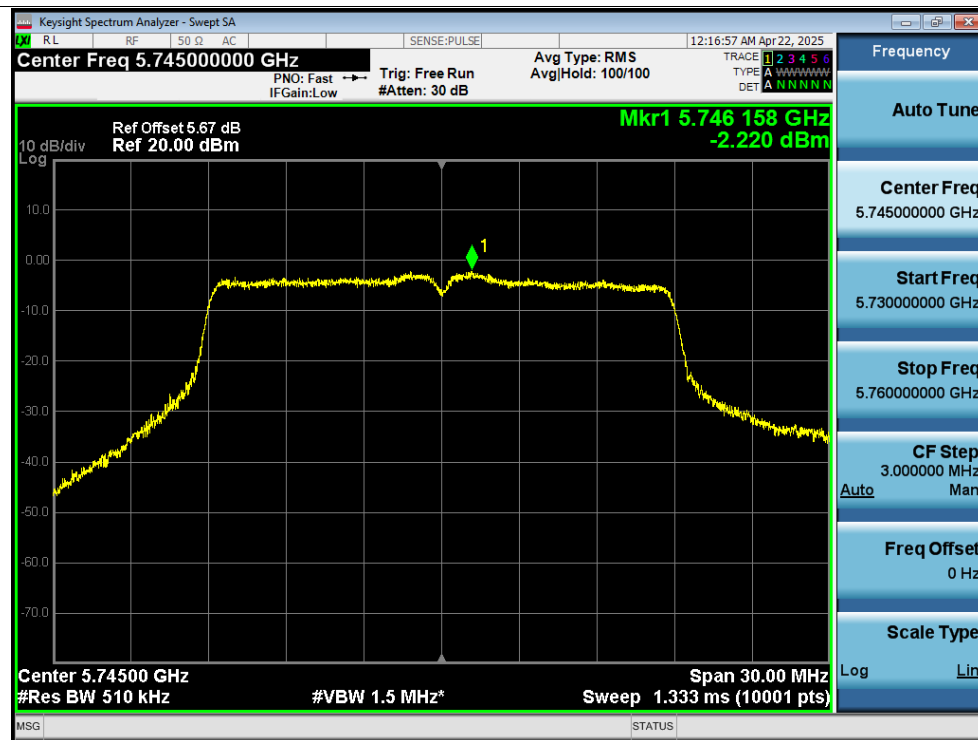


PSD NVNT n20 5745MHz Ant3




PSD NVNT n20 5785MHz Ant1



PSD NVNT n20 5785MHz Ant2

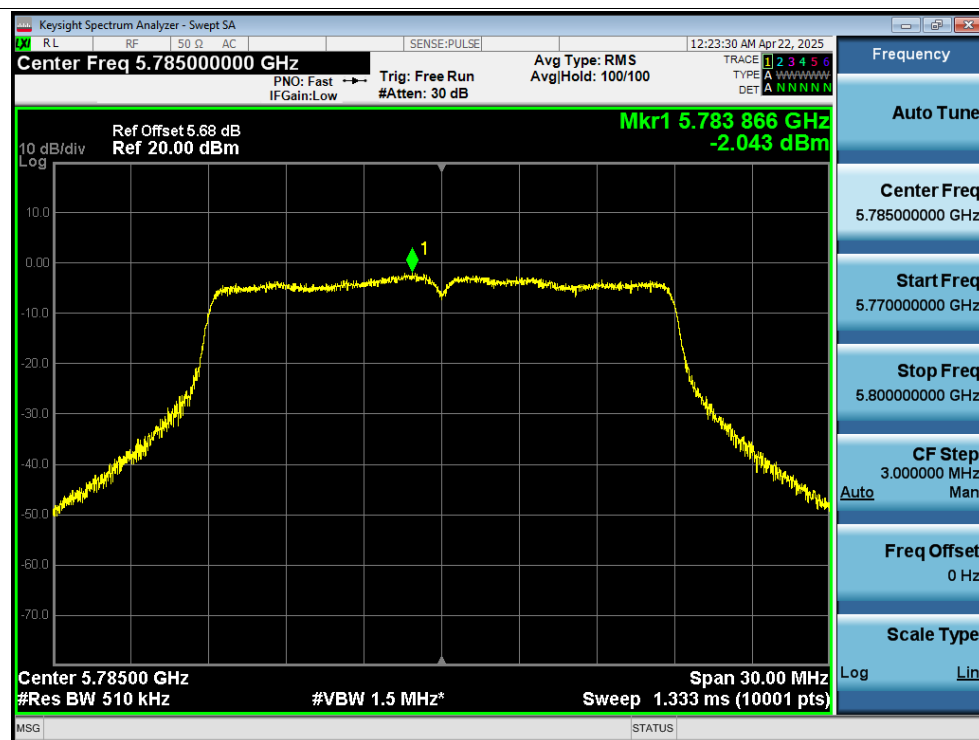


PSD NVNT n20 5785MHz Ant3

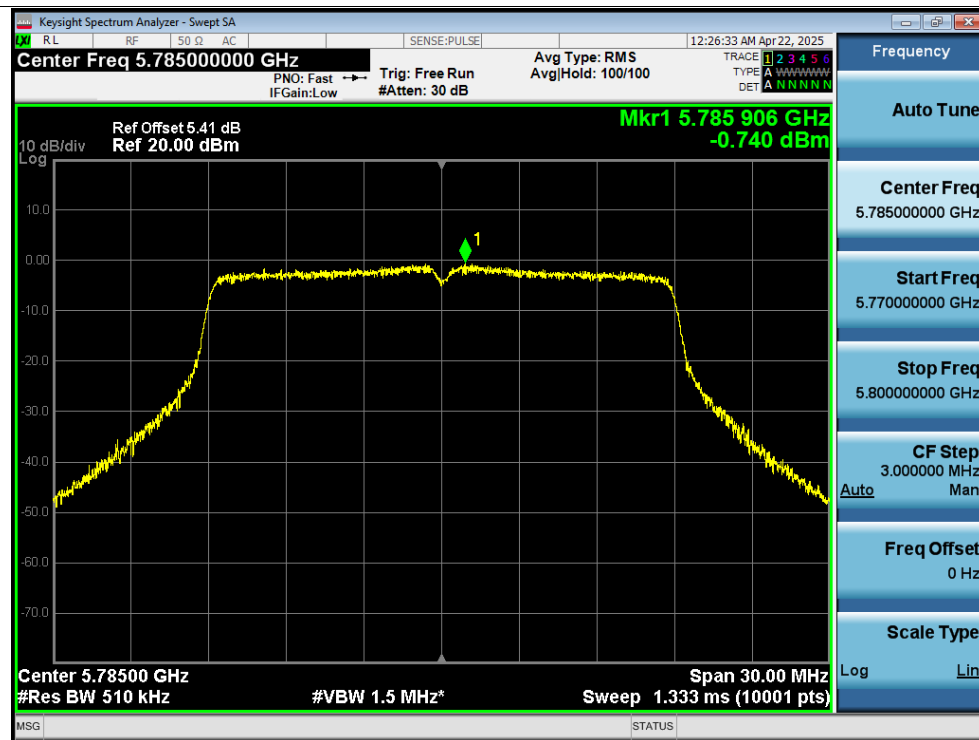

PSD NVNT n20 5825MHz Ant1



PSD NVNT n20 5825MHz Ant2

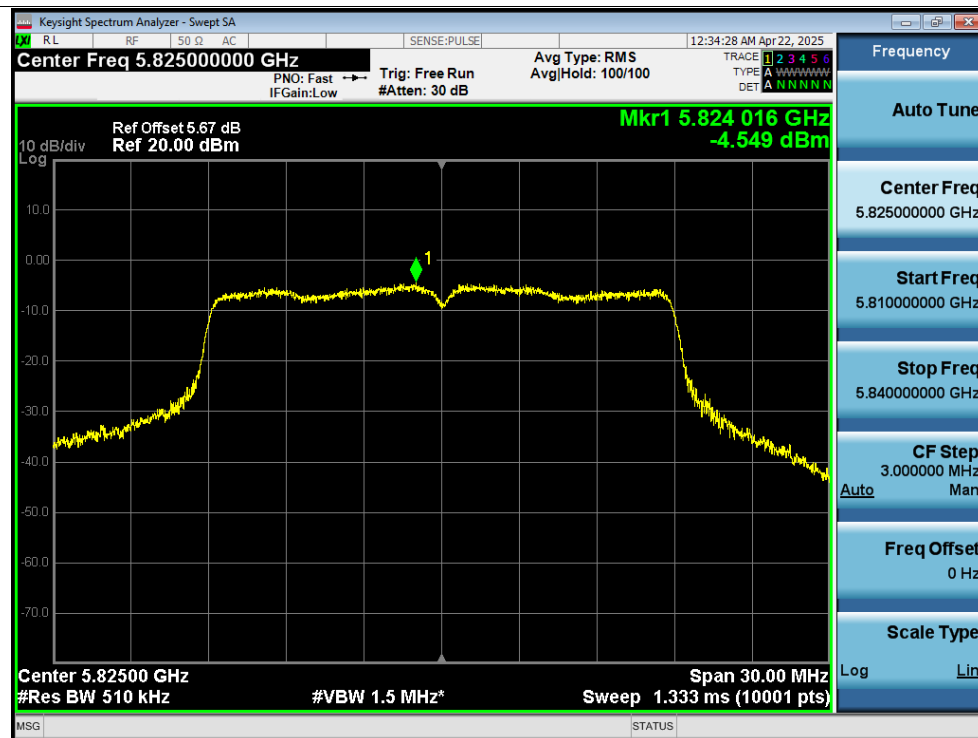


PSD NVNT n20 5825MHz Ant3




PSD NVNT n40 5190MHz Ant1




PSD NVNT n40 5190MHz Ant2

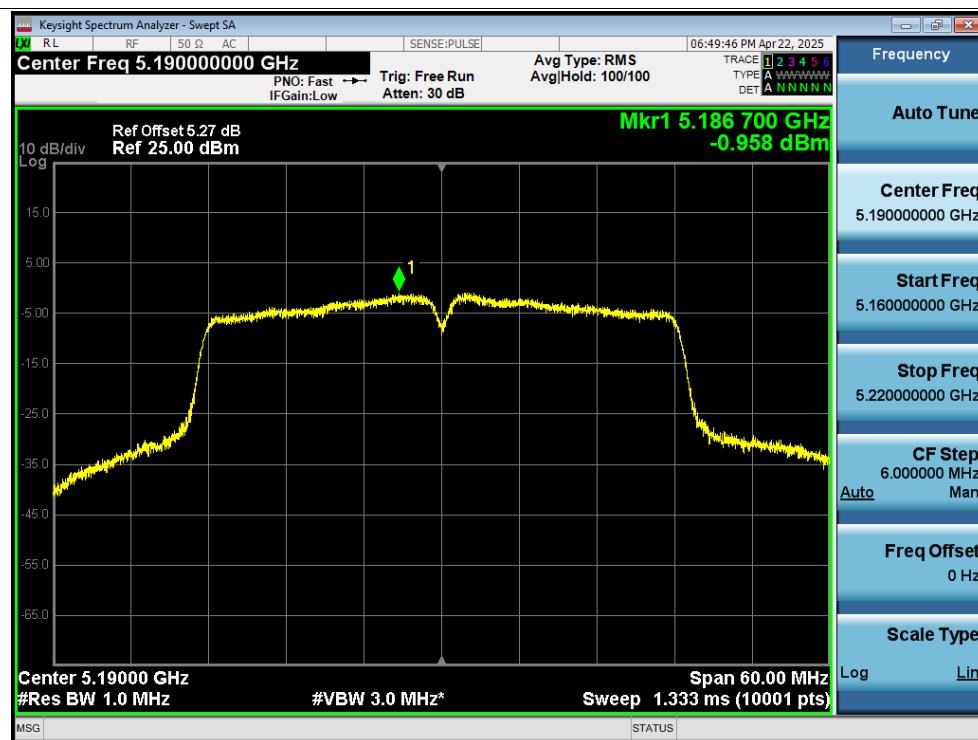

PSD NVNT n40 5190MHz Ant3

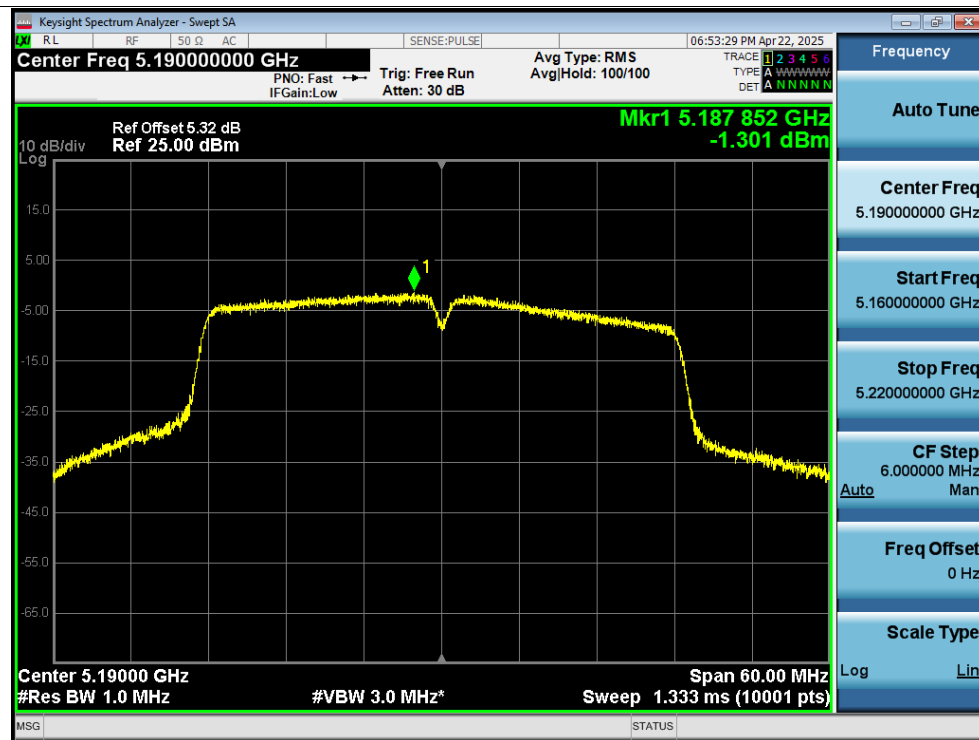

PSD NVNT n40 5230MHz Ant1

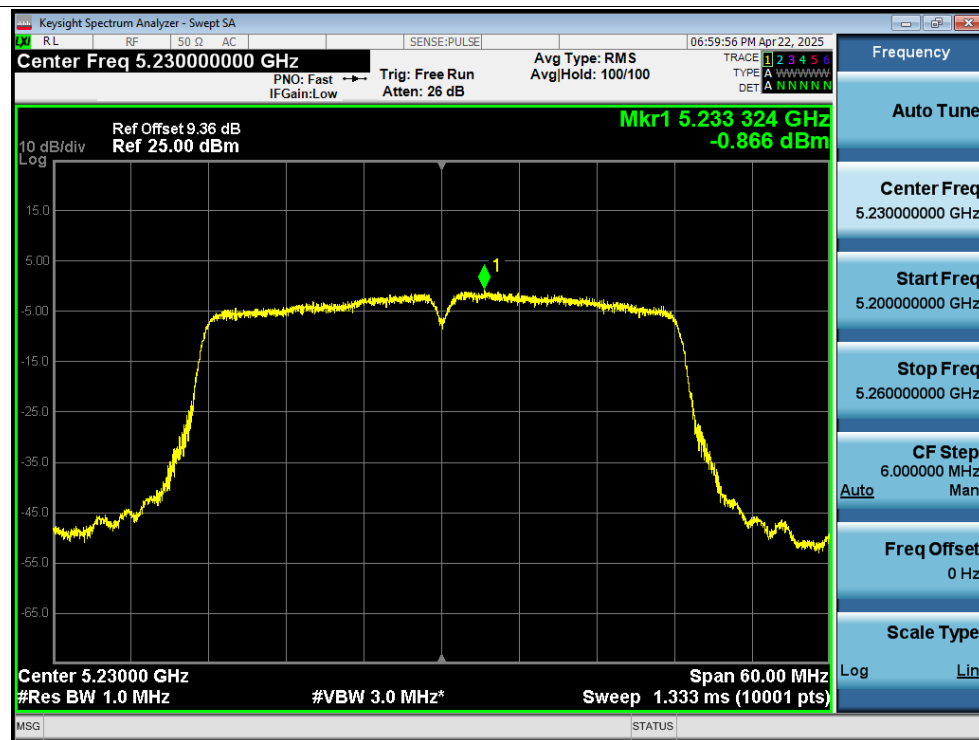


PSD NVNT n40 5230MHz Ant2




PSD NVNT n40 5230MHz Ant3



PSD NVNT n40 5270MHz Ant1

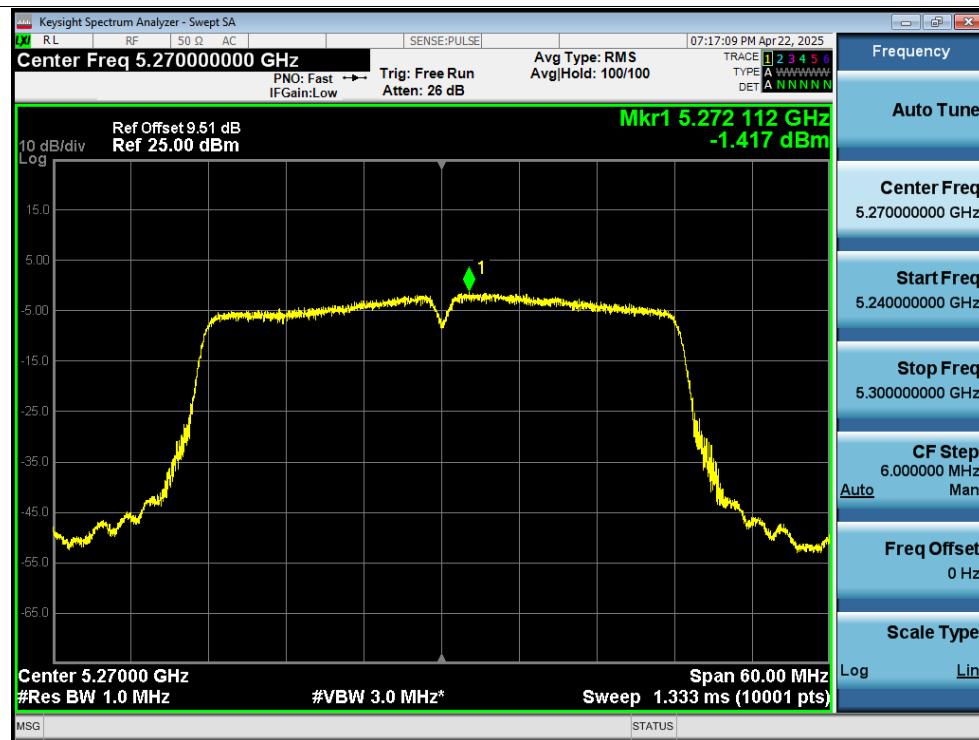

PSD NVNT n40 5270MHz Ant2

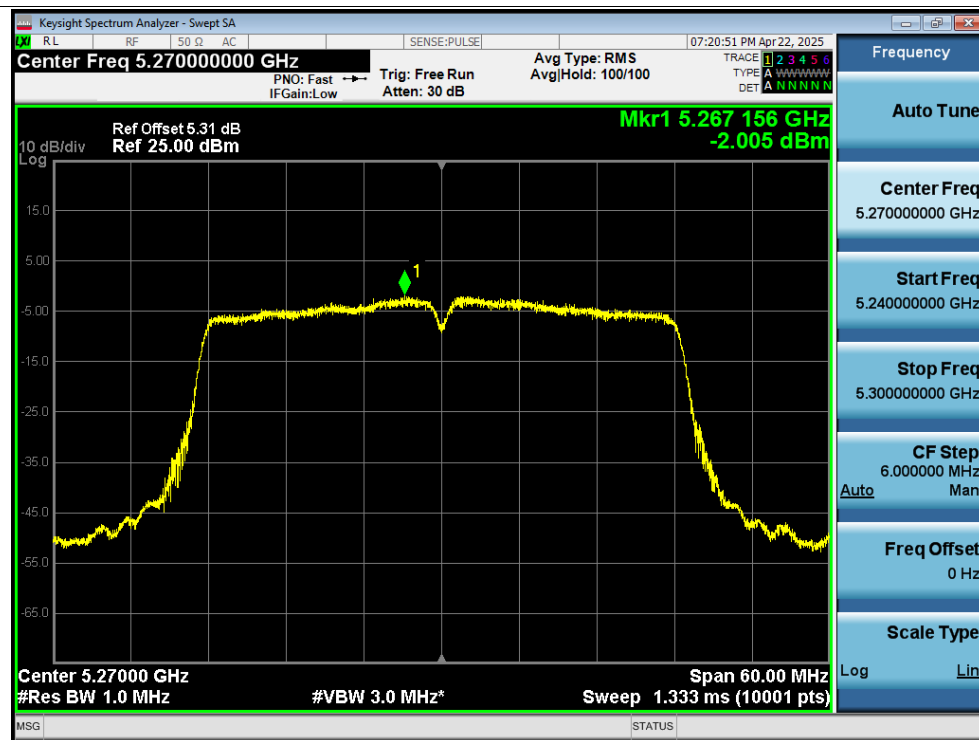

PSD NVNT n40 5270MHz Ant3




PSD NVNT n40 5310MHz Ant1



PSD NVNT n40 5310MHz Ant2



PSD NVNT n40 5310MHz Ant3

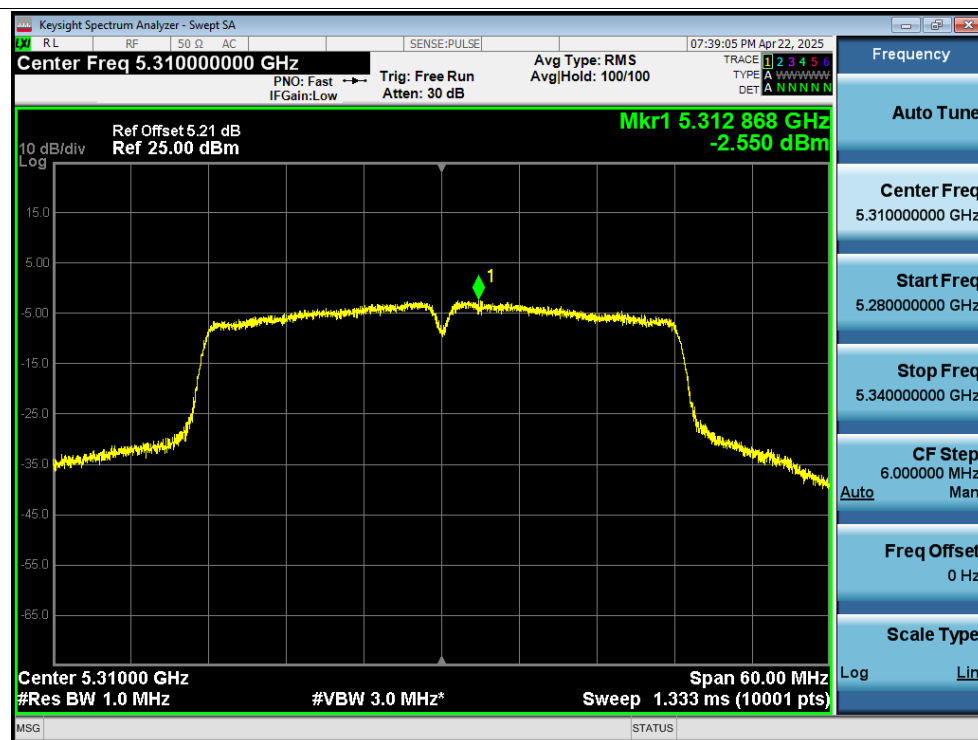

PSD NVNT n40 5510MHz Ant1



PSD NVNT n40 5510MHz Ant2

