



PSD NVNT ax20 5240MHz Ant2




PSD NVNT ax20 5240MHz Ant3

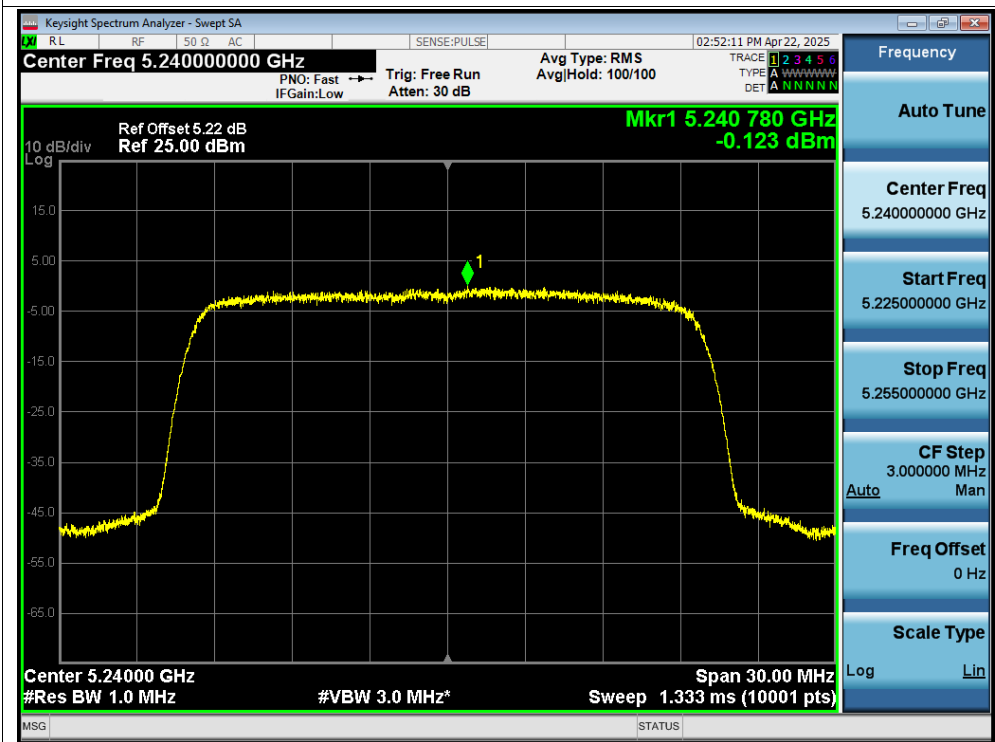


PSD NVNT ax20 5260MHz Ant1

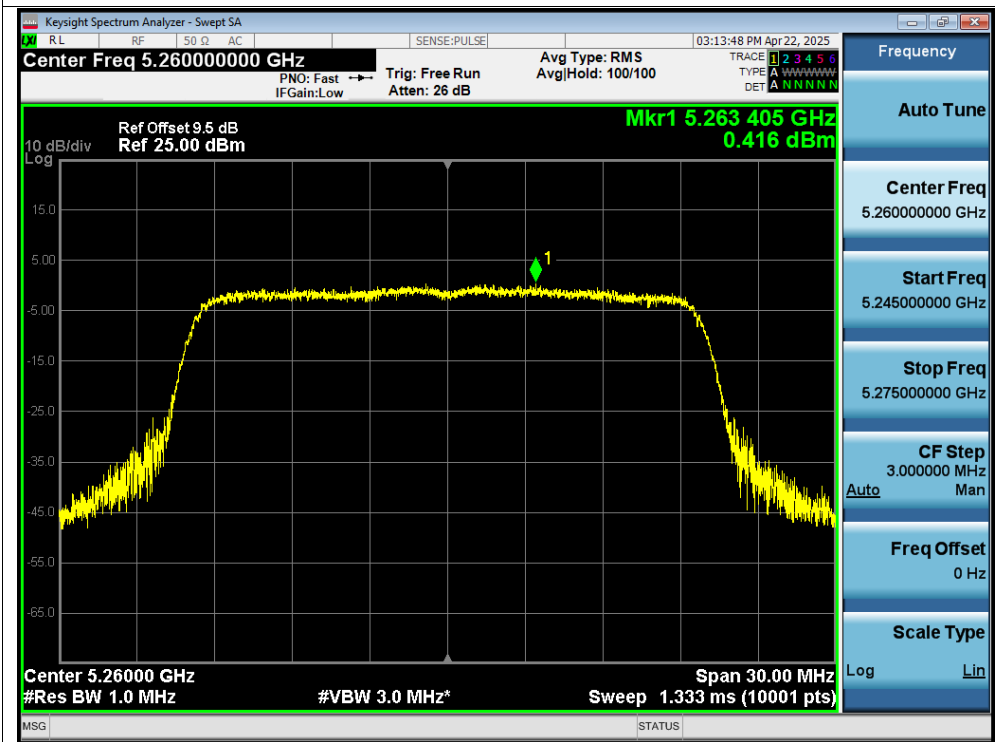


PSD NVNT ax20 5260MHz Ant2

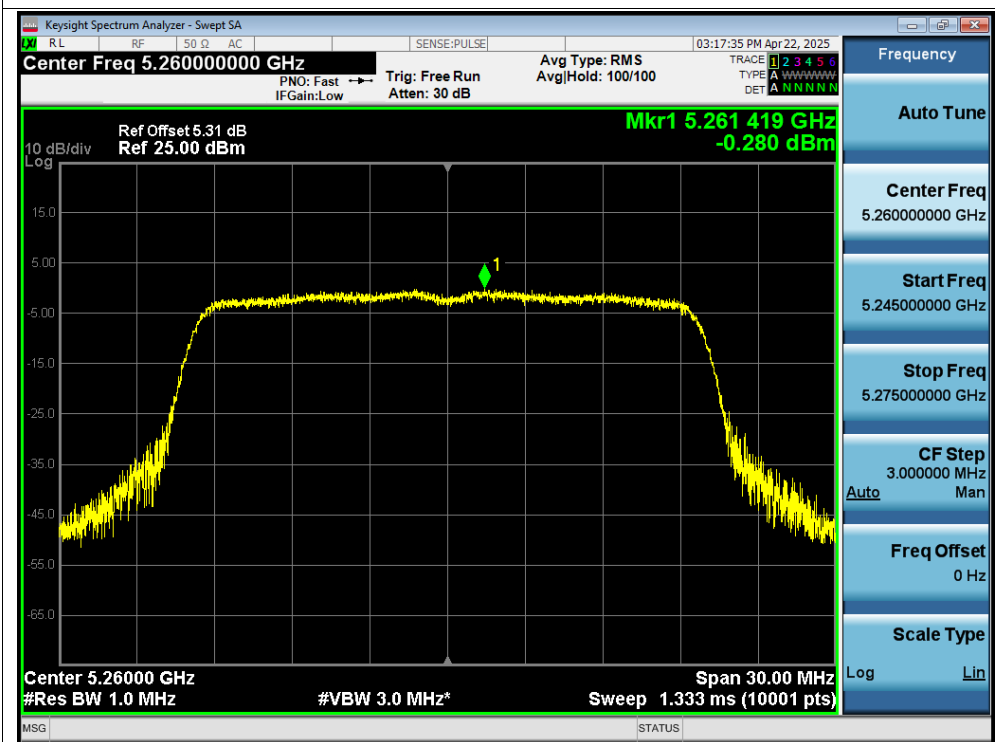


PSD NVNT ax20 5260MHz Ant3

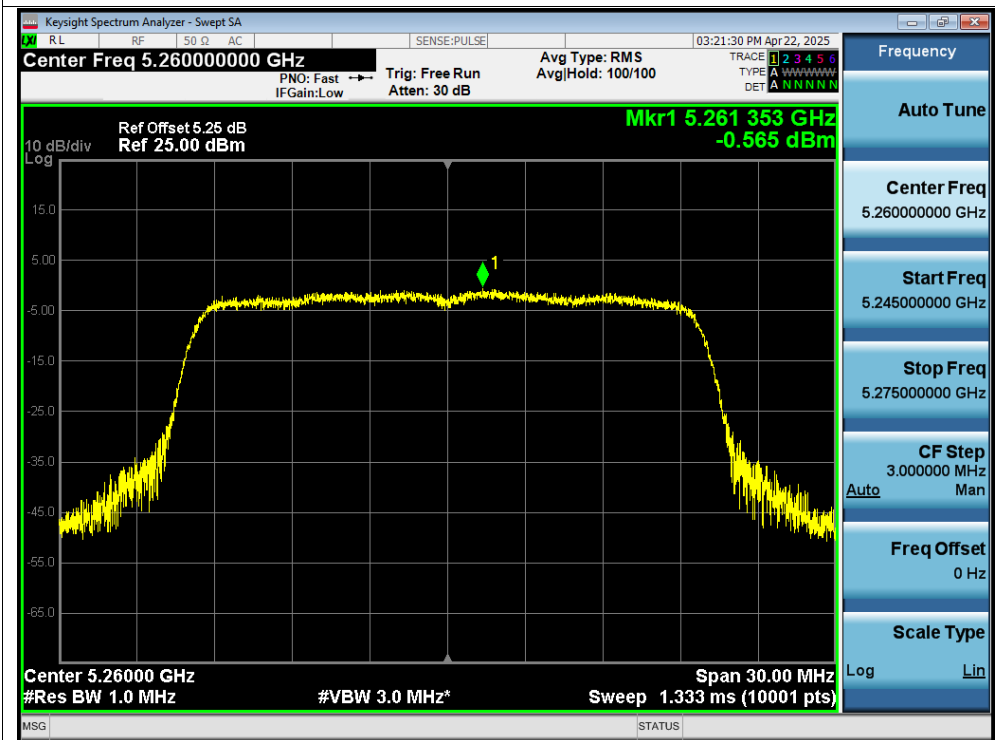


PSD NVNT ax20 5280MHz Ant1

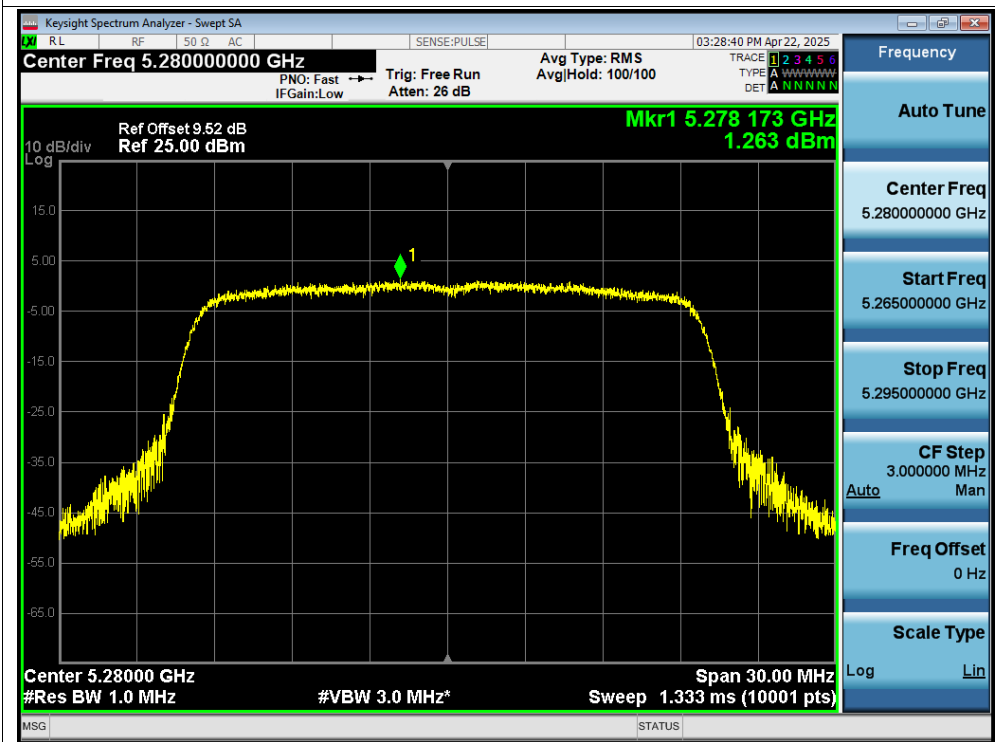

PSD NVNT ax20 5280MHz Ant2

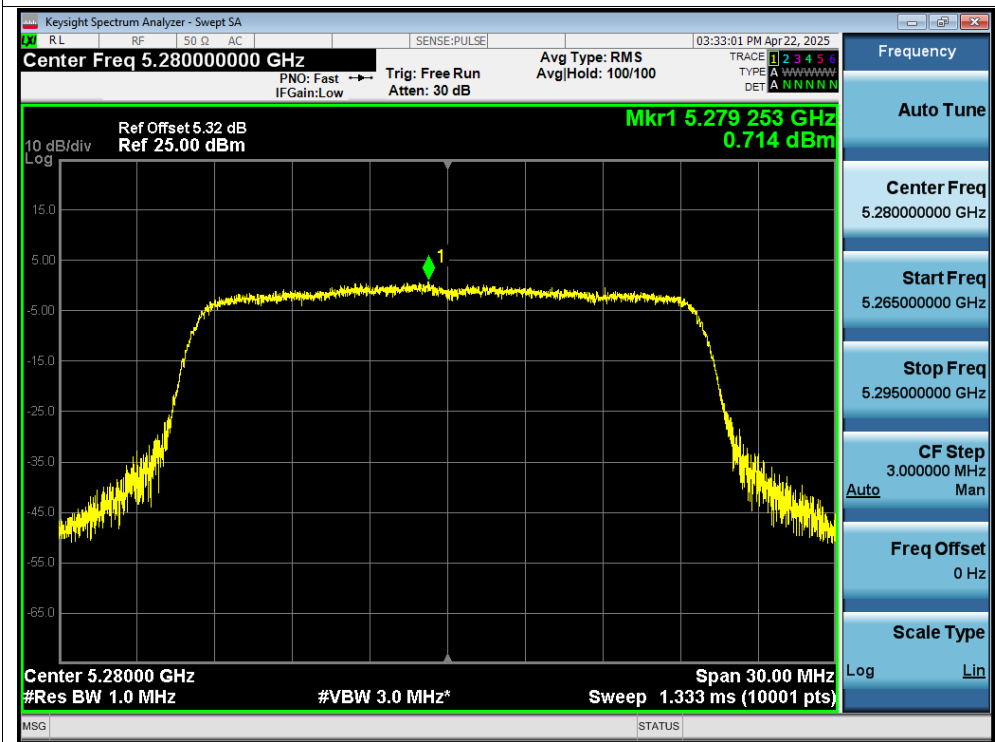

PSD NVNT ax20 5280MHz Ant3

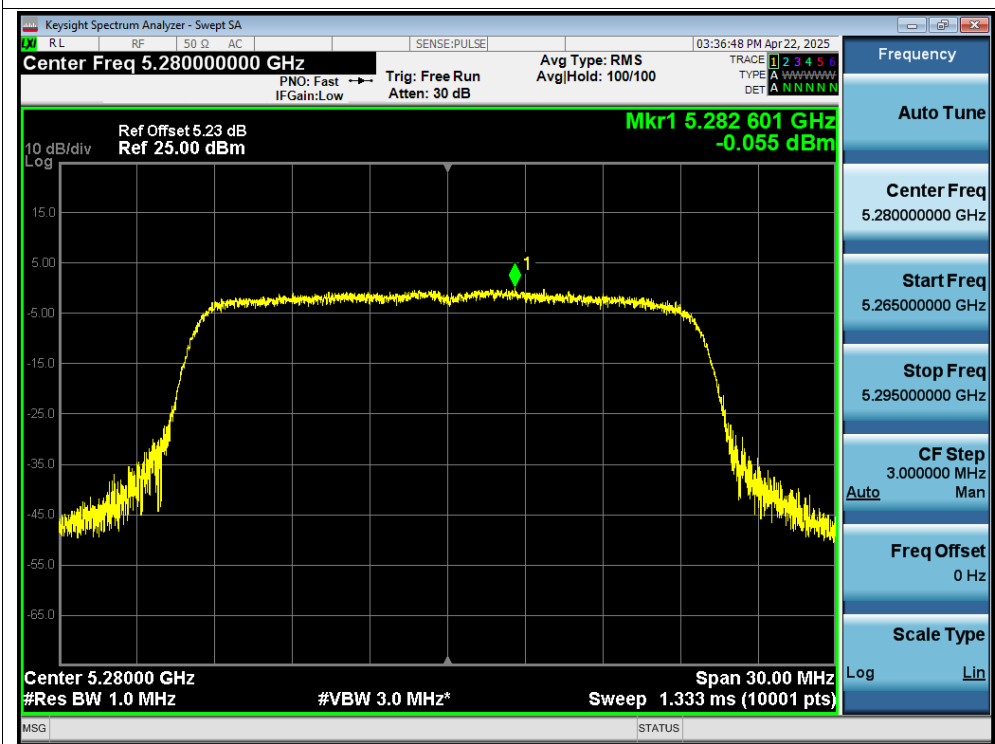

PSD NVNT ax20 5320MHz Ant1



PSD NVNT ax20 5320MHz Ant2




PSD NVNT ax20 5320MHz Ant3



PSD NVNT ax20 5500MHz Ant1




PSD NVNT ax20 5500MHz Ant2

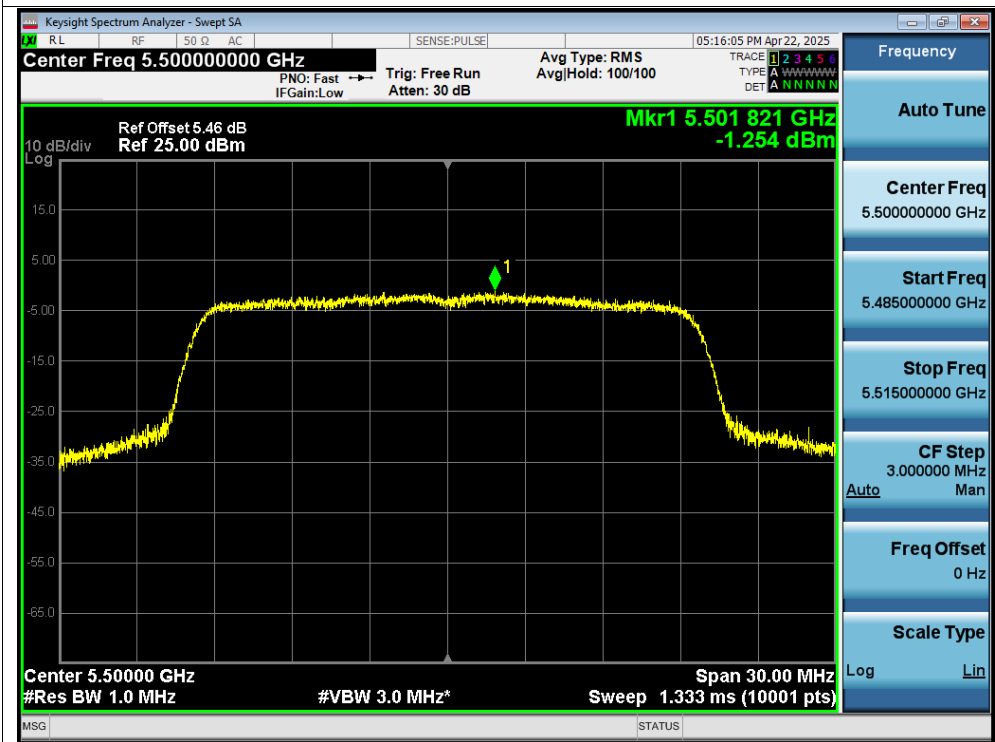


PSD NVNT ax20 5500MHz Ant3




PSD NVNT ax20 5600MHz Ant1

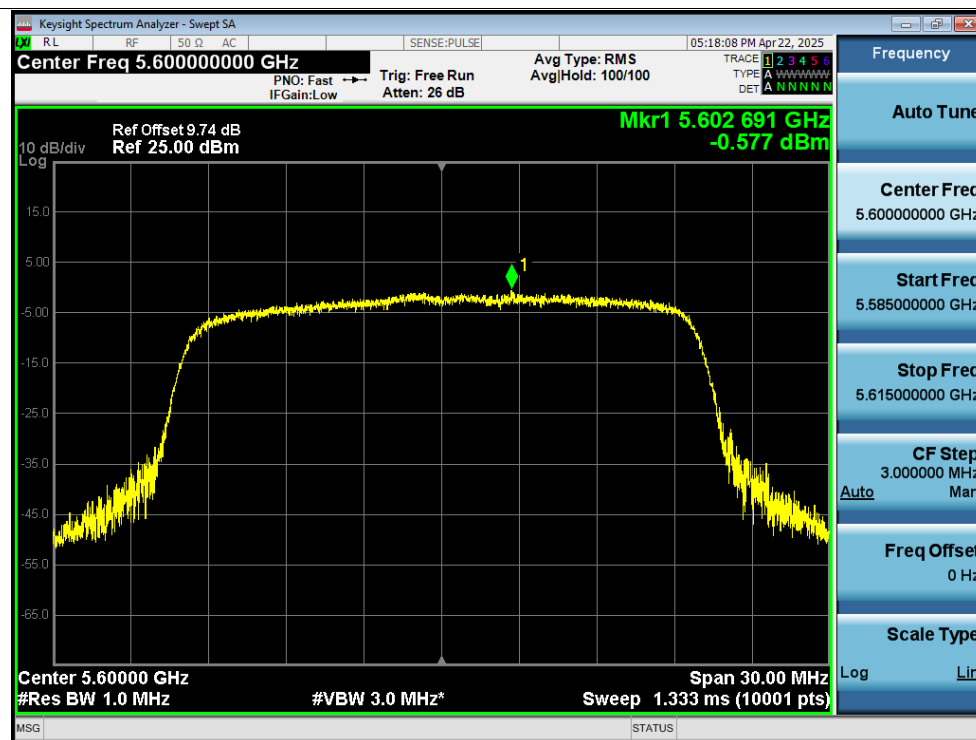


PSD NVNT ax20 5600MHz Ant2

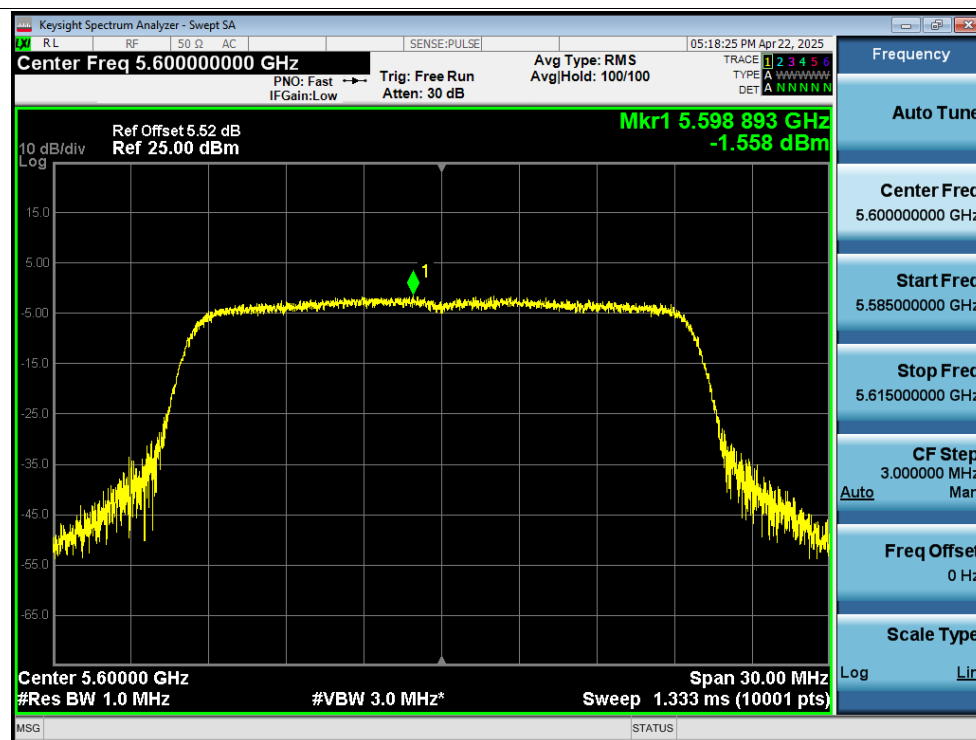


PSD NVNT ax20 5600MHz Ant3

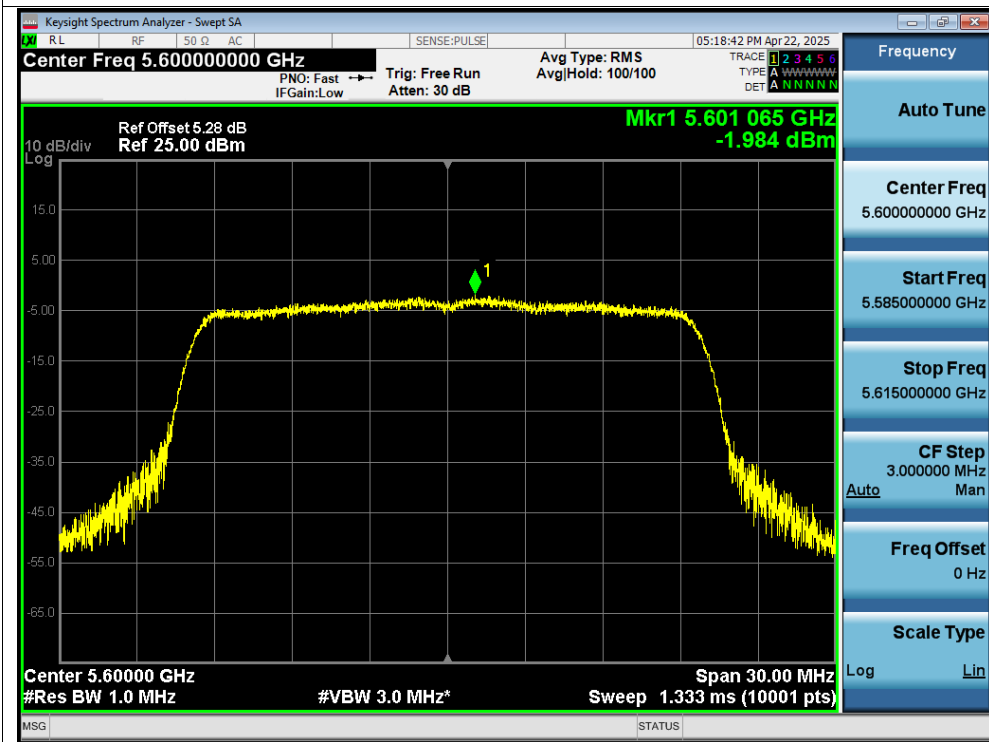


PSD NVNT ax20 5700MHz Ant1

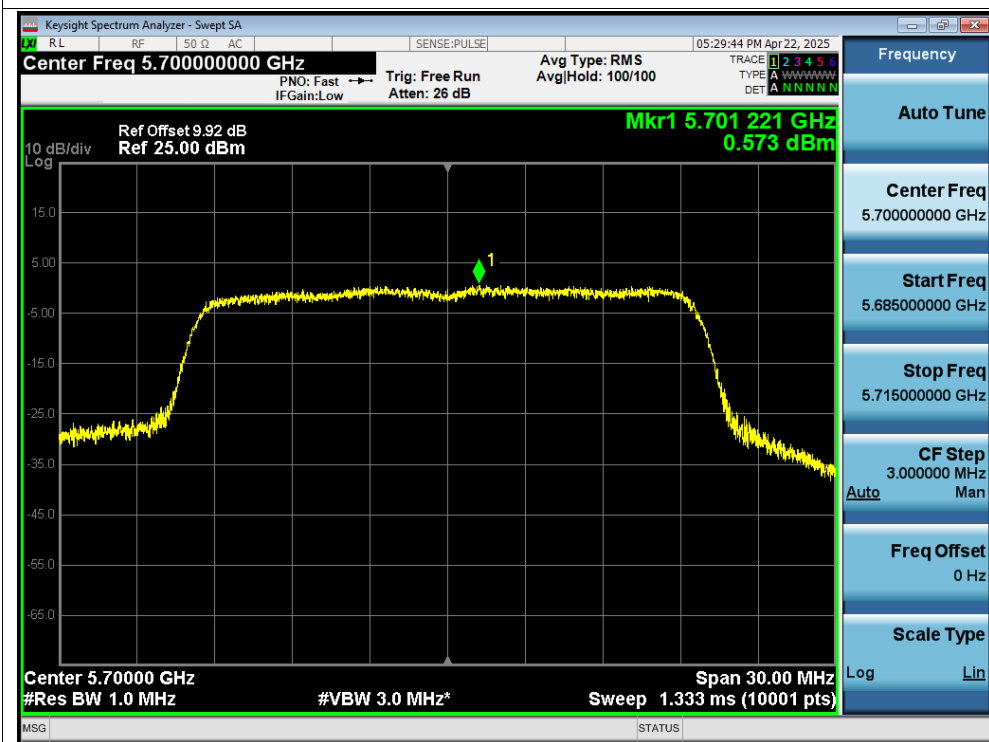

PSD NVNT ax20 5700MHz Ant2

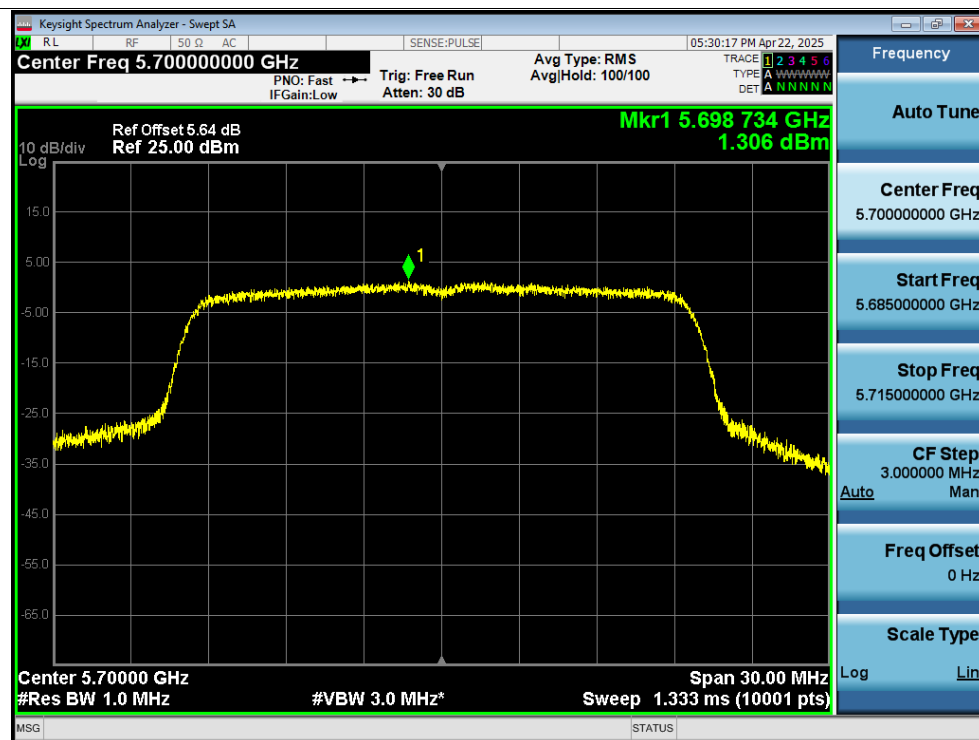

PSD NVNT ax20 5700MHz Ant3

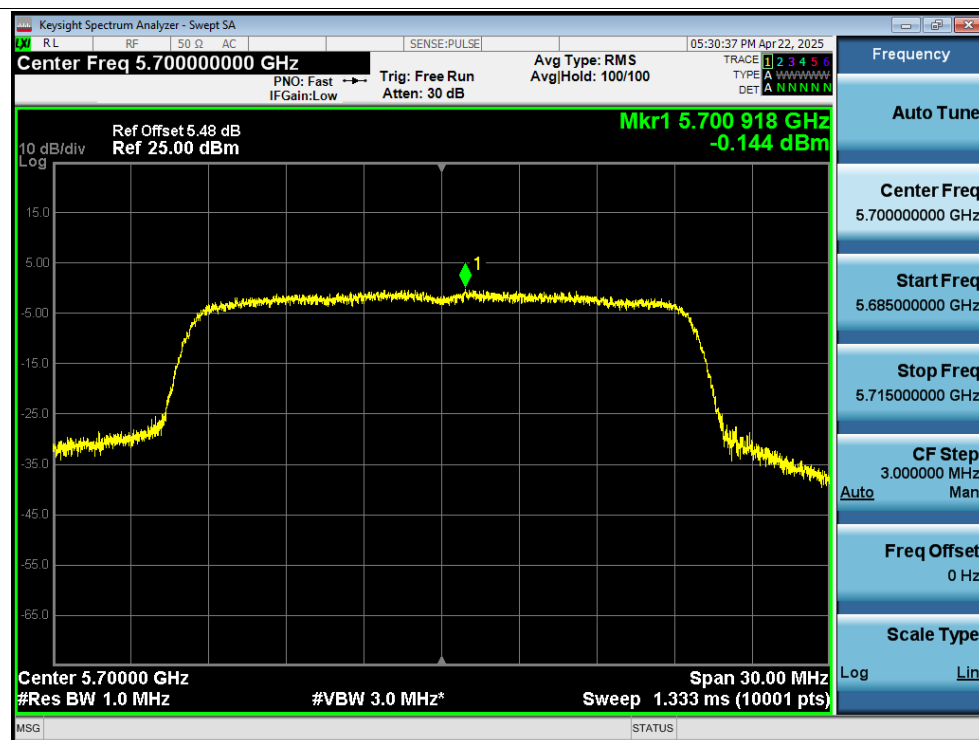


PSD NVNT ax20 5745MHz Ant1




PSD NVNT ax20 5745MHz Ant2




PSD NVNT ax20 5745MHz Ant3

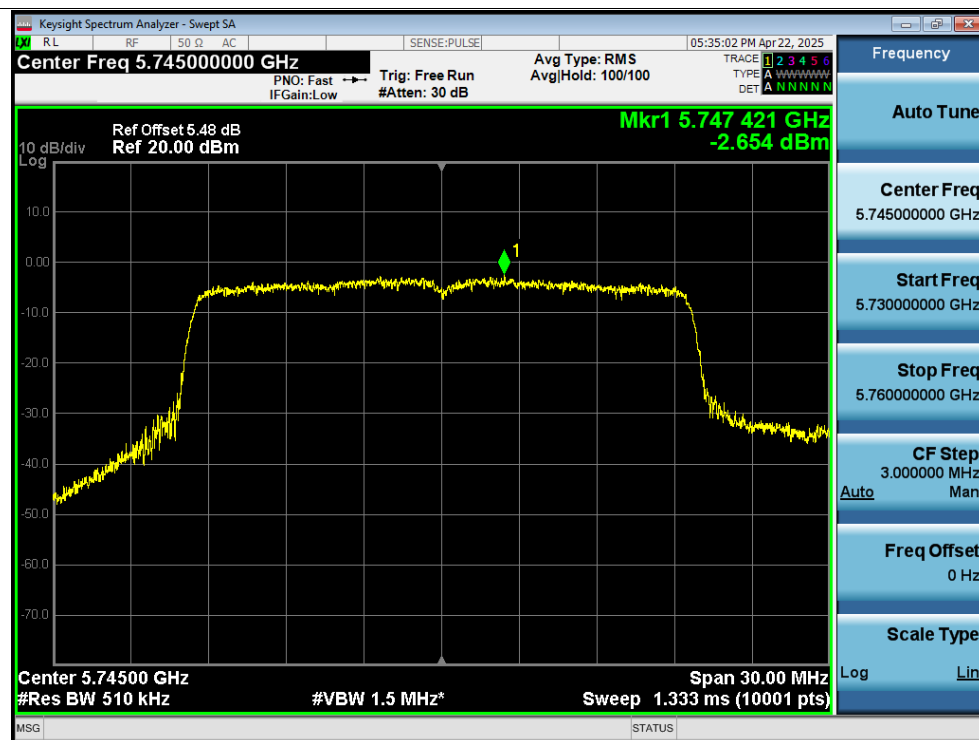

PSD NVNT ax20 5785MHz Ant1

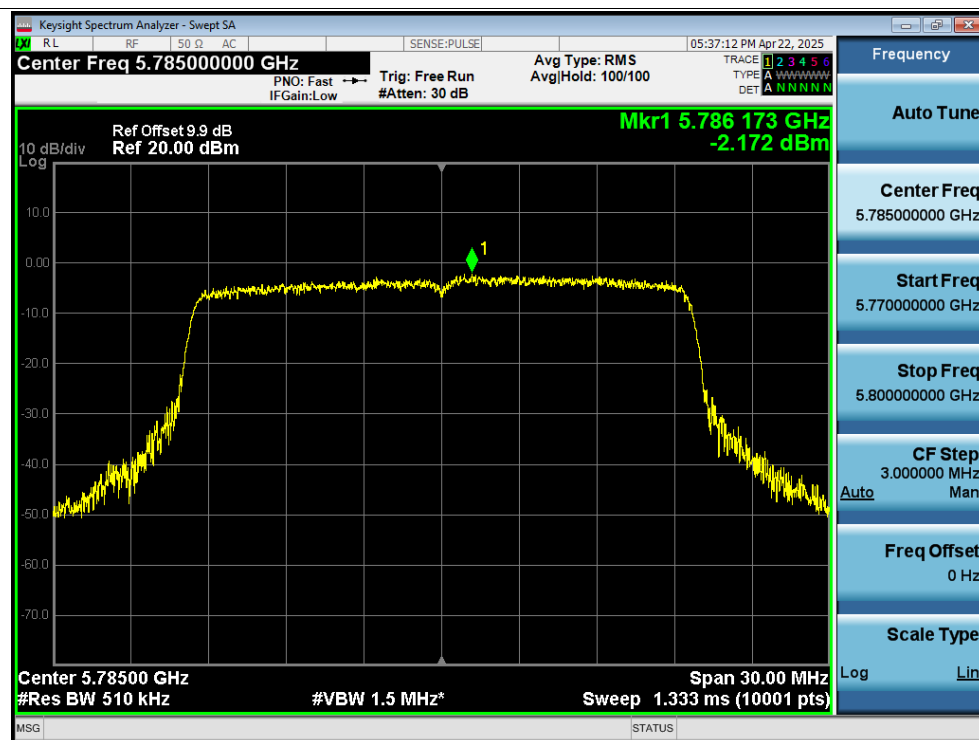

PSD NVNT ax20 5785MHz Ant2

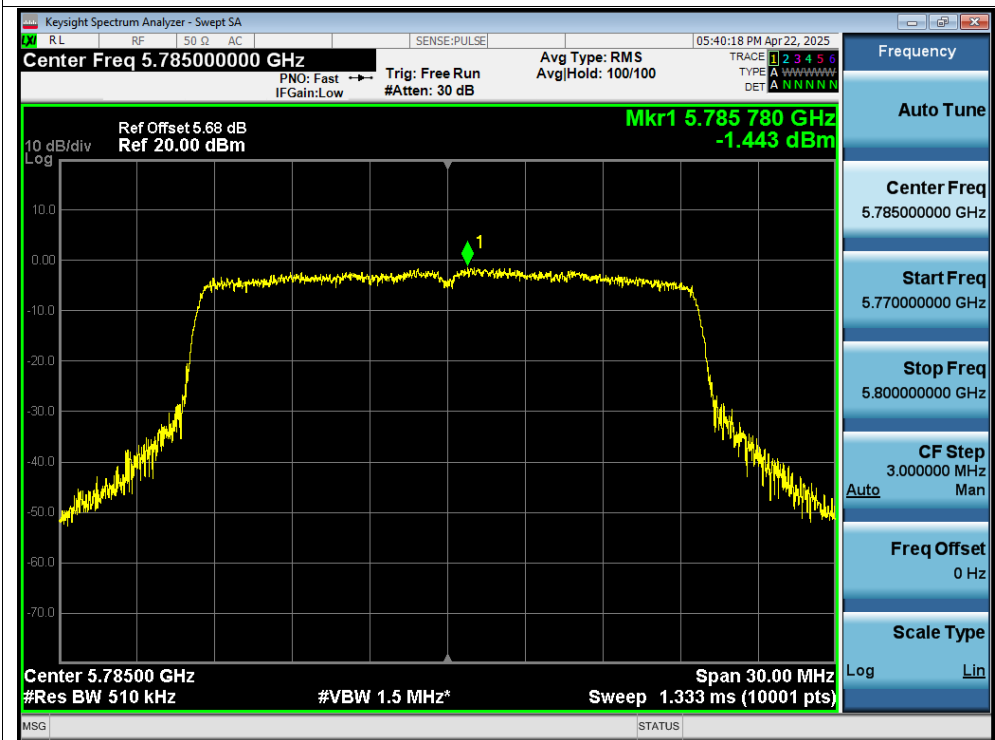

PSD NVNT ax20 5785MHz Ant3



PSD NVNT ax20 5825MHz Ant1



PSD NVNT ax20 5825MHz Ant2



PSD NVNT ax20 5825MHz Ant3



PSD NVNT ax40 5190MHz Ant1



PSD NVNT ax40 5190MHz Ant2



PSD NVNT ax40 5190MHz Ant3




PSD NVNT ax40 5230MHz Ant1




PSD NVNT ax40 5230MHz Ant2




PSD NVNT ax40 5230MHz Ant3

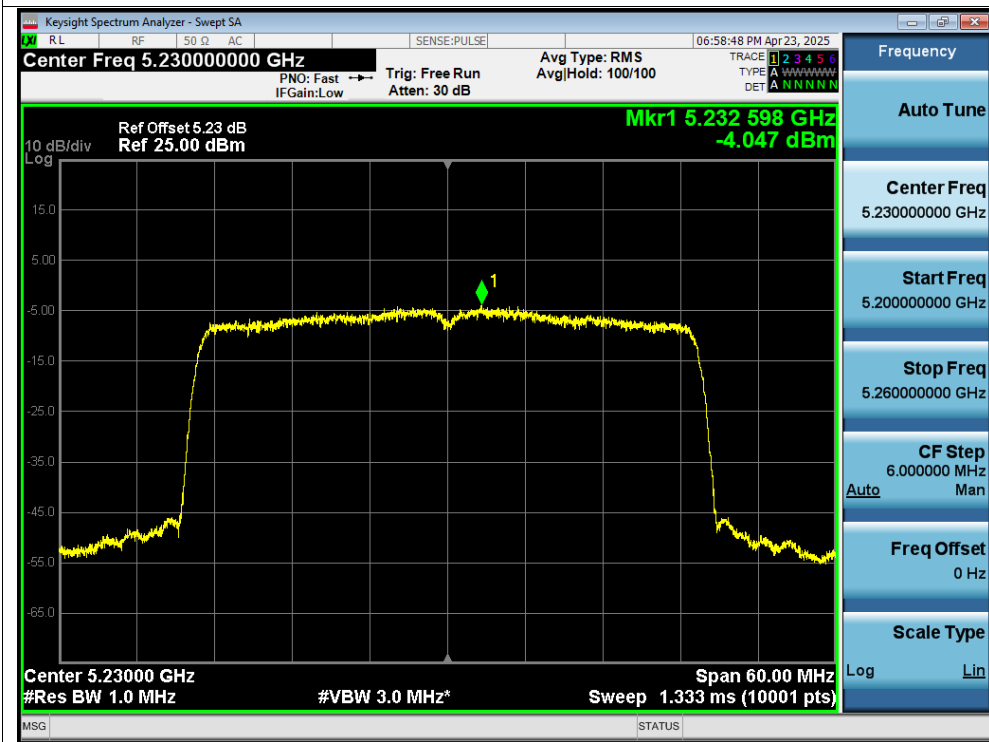


PSD NVNT ax40 5270MHz Ant1

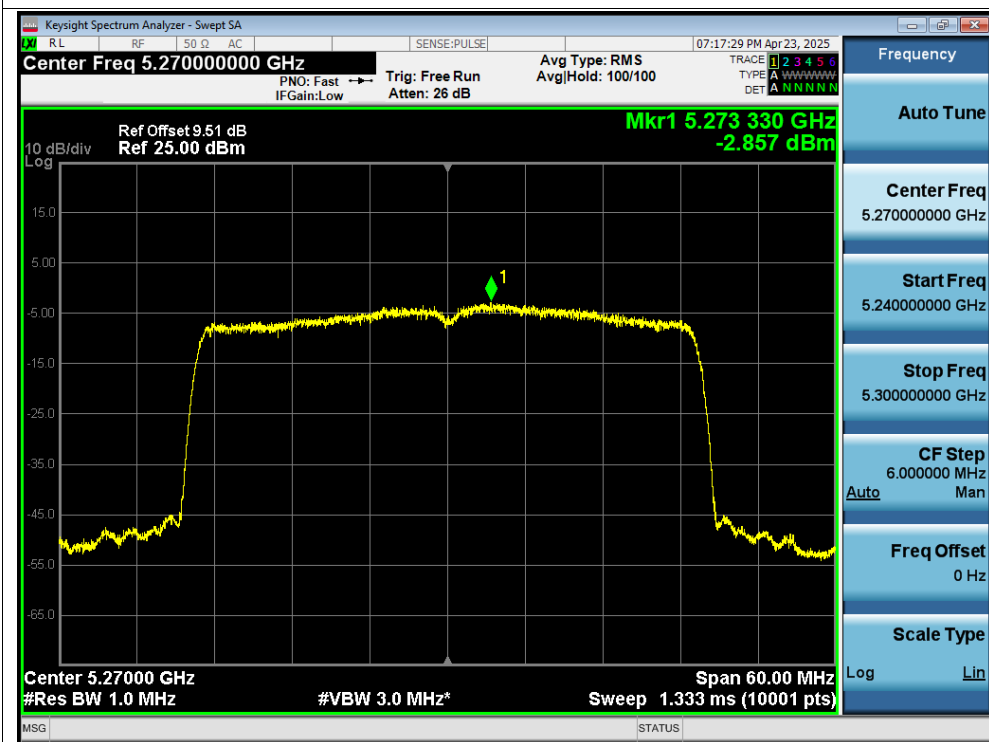

PSD NVNT ax40 5270MHz Ant2

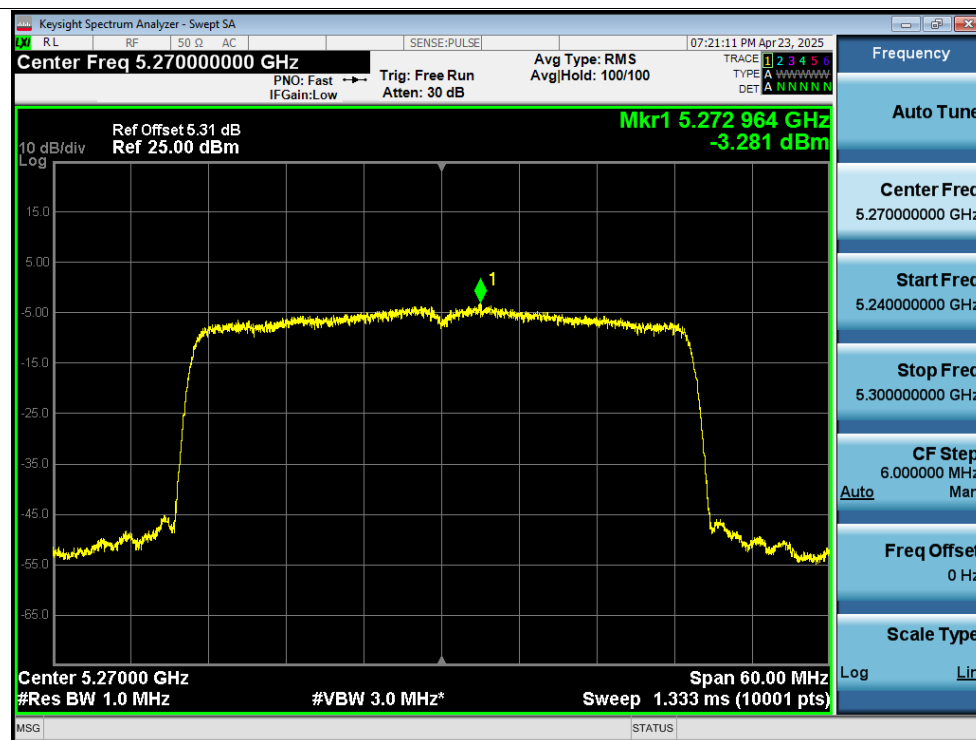

PSD NVNT ax40 5270MHz Ant3

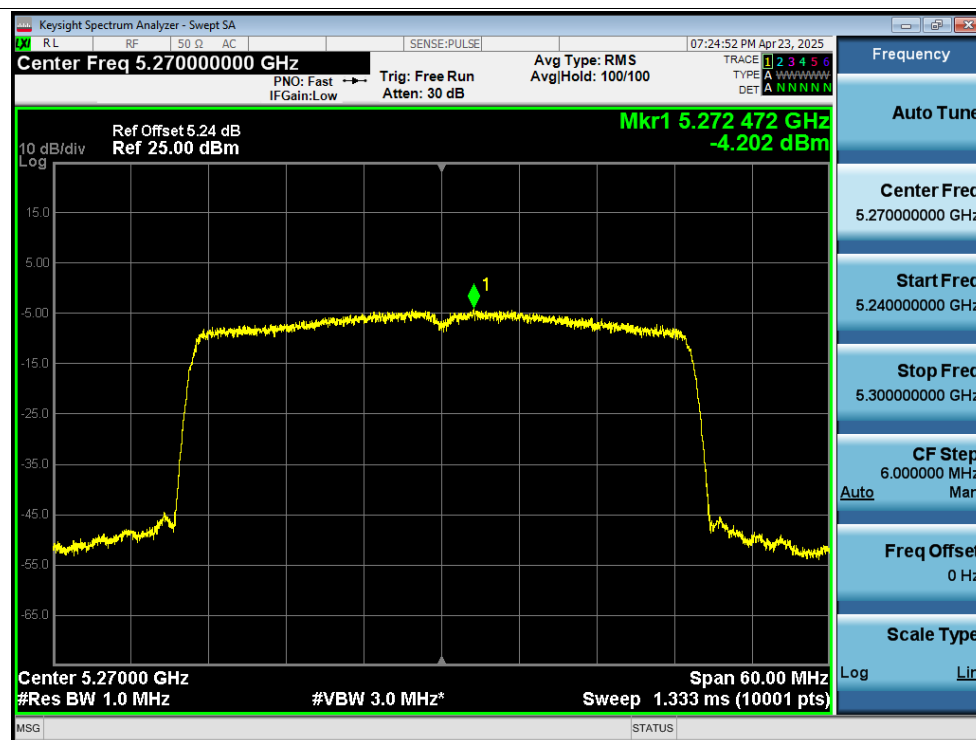

PSD NVNT ax40 5310MHz Ant1



PSD NVNT ax40 5310MHz Ant2



PSD NVNT ax40 5310MHz Ant3



PSD NVNT ax40 5510MHz Ant1



PSD NVNT ax40 5510MHz Ant2



PSD NVNT ax40 5510MHz Ant3




PSD NVNT ax40 5590MHz Ant1



PSD NVNT ax40 5590MHz Ant2



PSD NVNT ax40 5590MHz Ant3

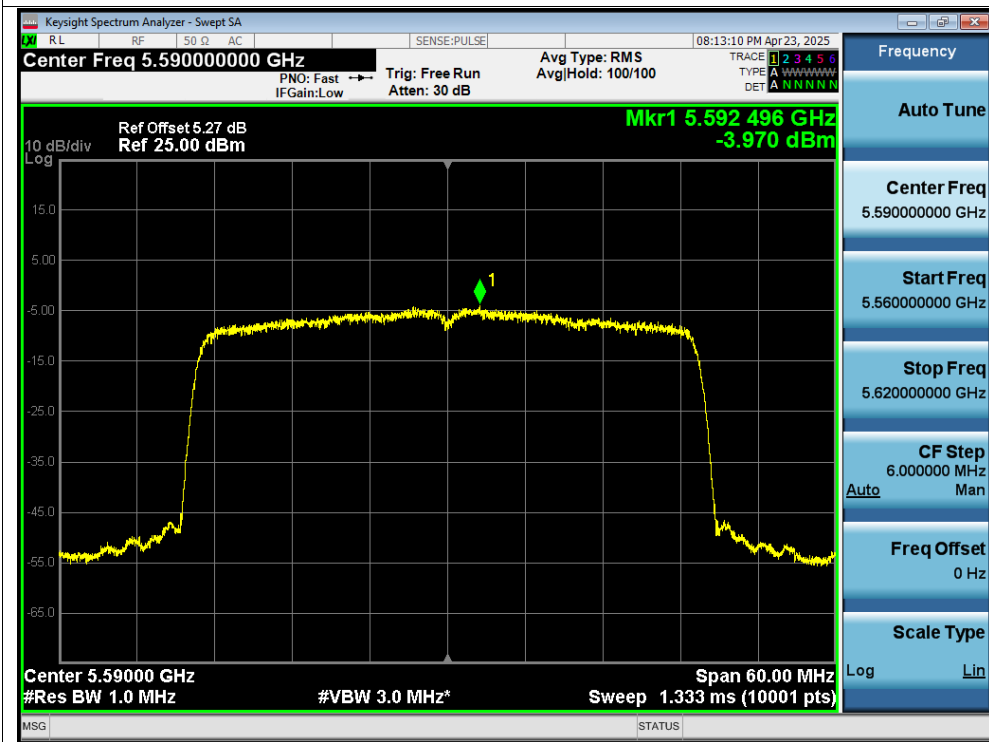

PSD NVNT ax40 5670MHz Ant1



PSD NVNT ax40 5670MHz Ant2



PSD NVNT ax40 5670MHz Ant3



PSD NVNT ax40 5755MHz Ant1



PSD NVNT ax40 5755MHz Ant2



PSD NVNT ax40 5755MHz Ant3



PSD NVNT ax40 5795MHz Ant1



PSD NVNT ax40 5795MHz Ant2



PSD NVNT ax40 5795MHz Ant3




PSD NVNT ax80 5210MHz Ant1



PSD NVNT ax80 5210MHz Ant2



PSD NVNT ax80 5210MHz Ant3

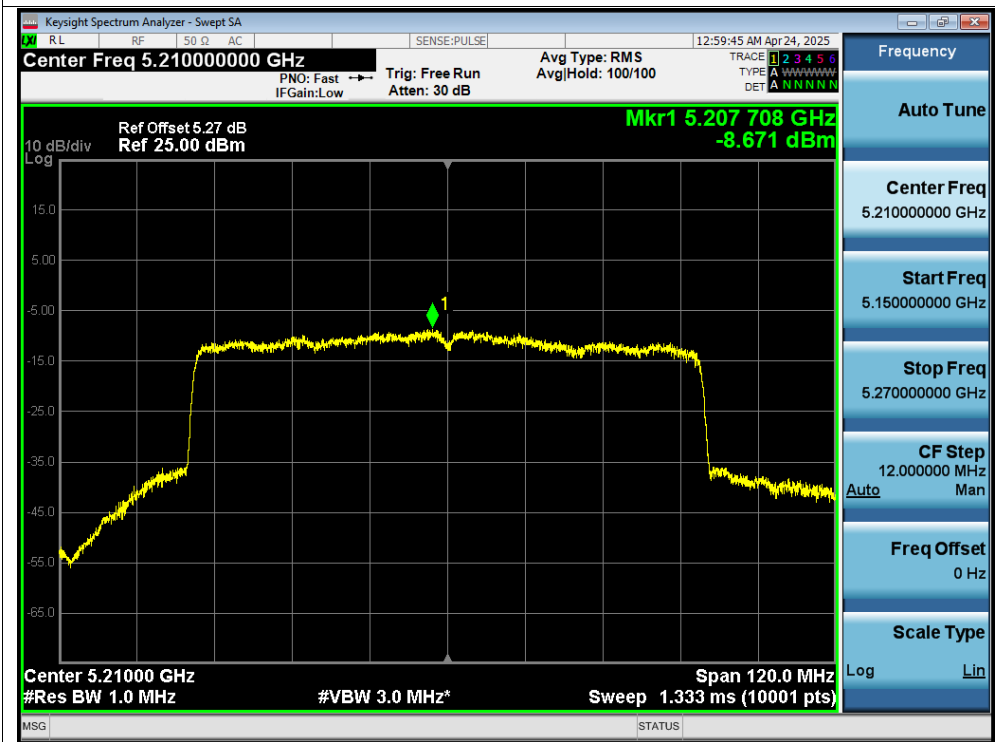

PSD NVNT ax80 5290MHz Ant1



PSD NVNT ax80 5290MHz Ant2




PSD NVNT ax80 5290MHz Ant3




PSD NVNT ax80 5530MHz Ant1



PSD NVNT ax80 5530MHz Ant2

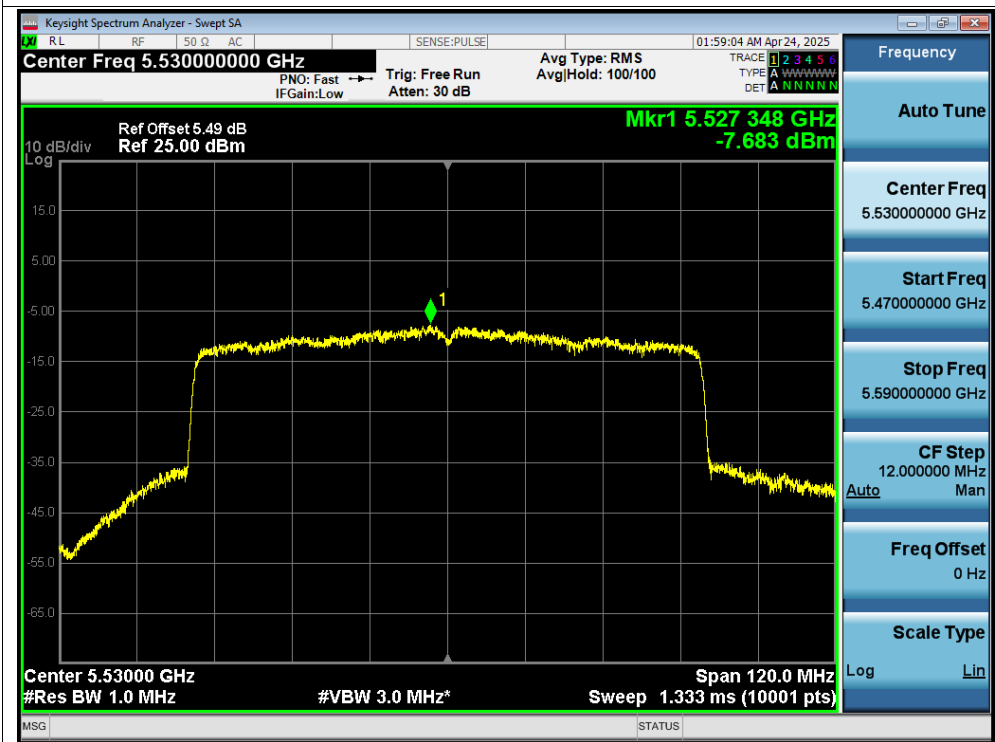


PSD NVNT ax80 5530MHz Ant3

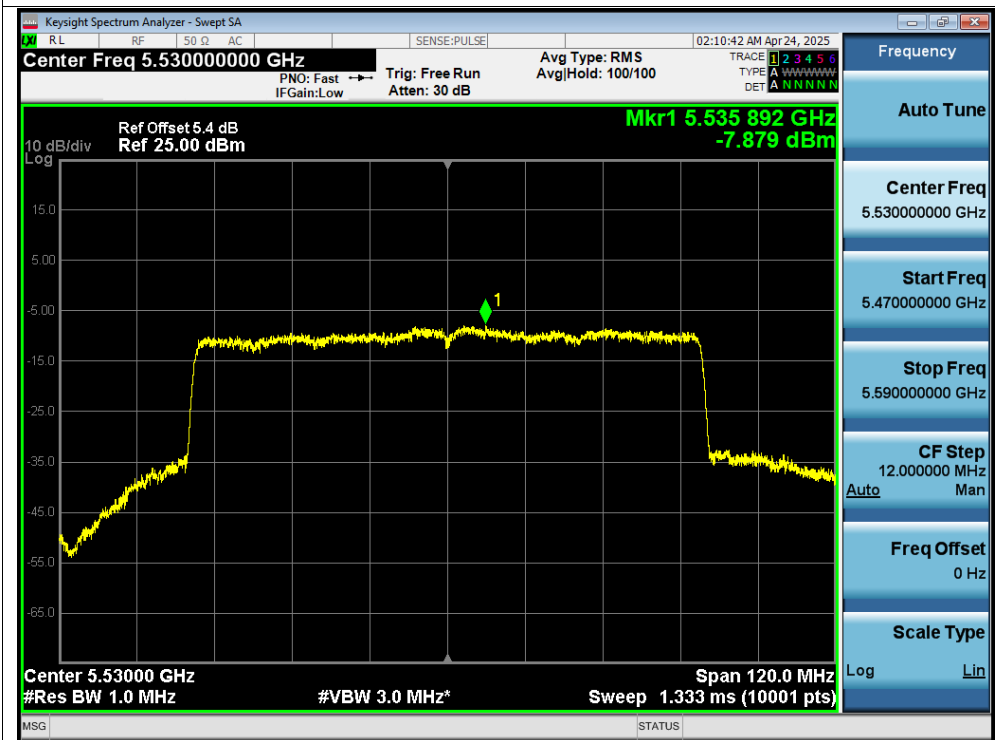


PSD NVNT ax80 5610MHz Ant1



PSD NVNT ax80 5610MHz Ant2

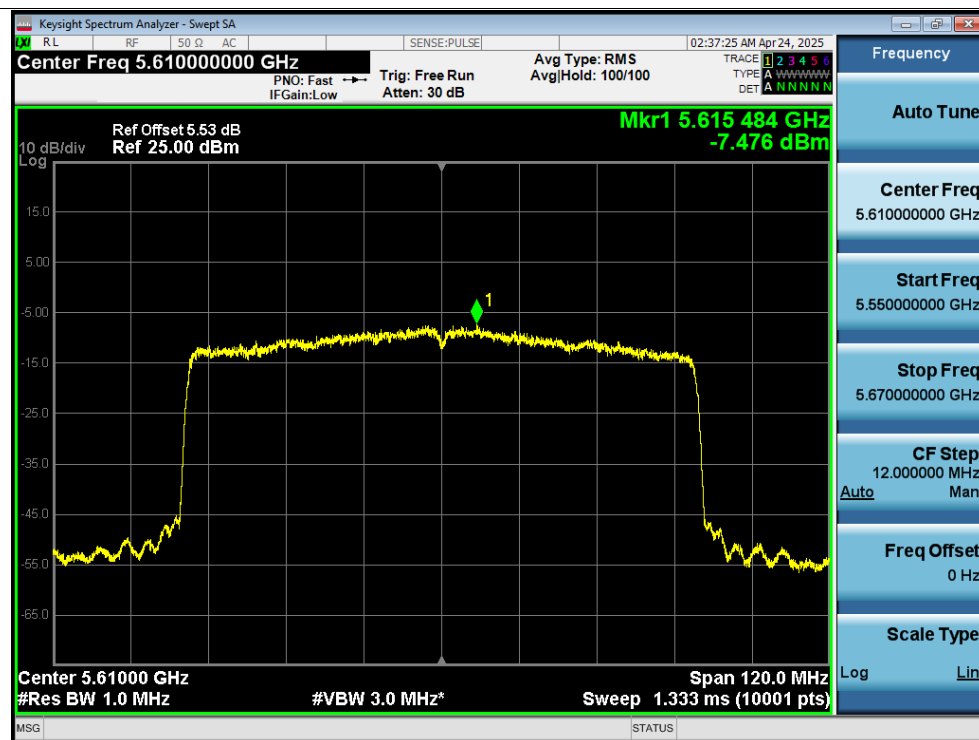

PSD NVNT ax80 5610MHz Ant3

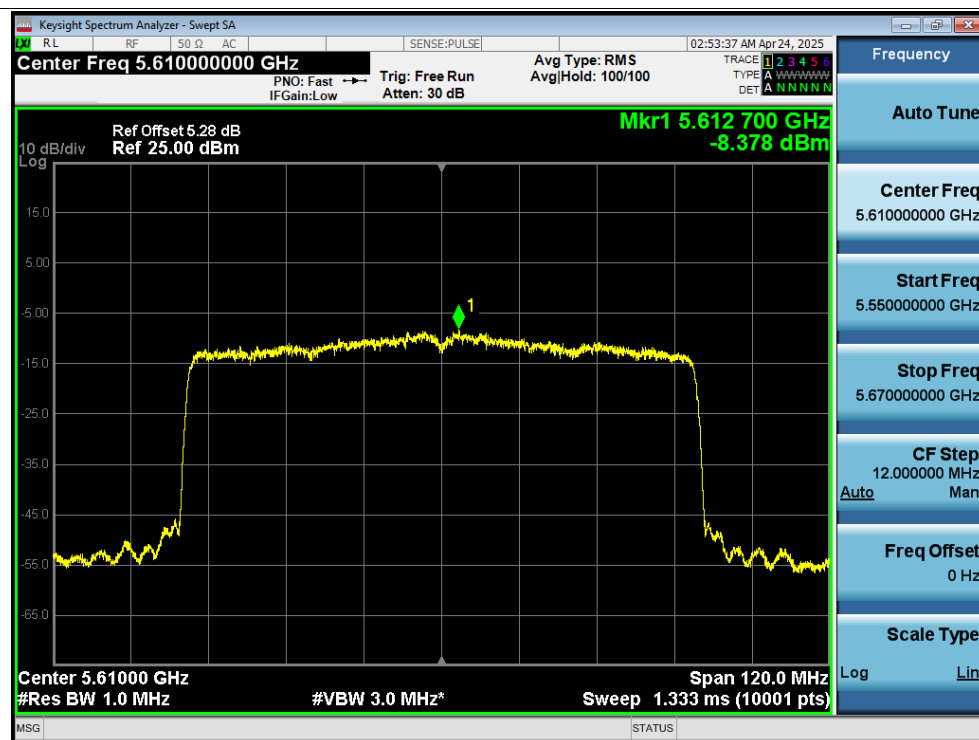

PSD NVNT ax80 5775MHz Ant1



PSD NVNT ax80 5775MHz Ant2



Frequency Stability

Condition	Mode	Time (mins)	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 10.2V	a	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 12V	a	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
20C 13.8V	a	0	5180	Ant1	5180	0	0	25	Pass
-20C 12V	a	0	5180	Ant1	5180	0	0	25	Pass
-10C 12V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 12V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 12V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 12V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 12V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
50C 12V	a	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 10.2V	a	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 12V	a	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 13.8V	a	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-20C 12V	a	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-10C 12V	a	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
0C 12V	a	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
10C 12V	a	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
30C 12V	a	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
40C 12V	a	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
50C 12V	a	0	5200	Ant1	5199.96	-40000	-7.69	25	Pass
20C 10.2V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 12V	a	0	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 13.8V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-20C 12V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 12V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 12V	a	0	5240	Ant1	5239.96	-40000	-7.63	25	Pass
10C 12V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
30C 12V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 12V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
50C 12V	a	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 10.2V	a	0	5260	Ant1	5259.96	-40000	-7.6	25	Pass
20C 12V	a	0	5260	Ant1	5260	0	0	25	Pass
20C 13.8V	a	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 12V	a	0	5260	Ant1	5260	0	0	25	Pass
-10C 12V	a	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 12V	a	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
10C 12V	a	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass

30C 12V	a	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
40C 12V	a	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
50C 12V	a	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 10.2V	a	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 12V	a	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 13.8V	a	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-20C 12V	a	0	5280	Ant1	5280	0	0	25	Pass
-10C 12V	a	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
0C 12V	a	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
10C 12V	a	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
30C 12V	a	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 12V	a	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
50C 12V	a	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 10.2V	a	0	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 12V	a	0	5320	Ant1	5320	0	0	25	Pass
20C 13.8V	a	0	5320	Ant1	5320	0	0	25	Pass
-20C 12V	a	0	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-10C 12V	a	0	5320	Ant1	5319.98	-20000	-3.76	25	Pass
0C 12V	a	0	5320	Ant1	5319.96	-40000	-7.52	25	Pass
10C 12V	a	0	5320	Ant1	5319.98	-20000	-3.76	25	Pass
30C 12V	a	0	5320	Ant1	5319.98	-20000	-3.76	25	Pass
40C 12V	a	0	5320	Ant1	5319.98	-20000	-3.76	25	Pass
50C 12V	a	0	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 10.2V	a	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 12V	a	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 13.8V	a	0	5500	Ant1	5500	0	0	25	Pass
-20C 12V	a	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-10C 12V	a	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
0C 12V	a	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
10C 12V	a	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
30C 12V	a	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
40C 12V	a	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
50C 12V	a	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 10.2V	a	0	5600	Ant1	5599.98	-20000	-3.57	25	Pass
20C 12V	a	0	5600	Ant1	5599.98	-20000	-3.57	25	Pass
20C 13.8V	a	0	5600	Ant1	5599.98	-20000	-3.57	25	Pass
-20C 12V	a	0	5600	Ant1	5599.98	-20000	-3.57	25	Pass
-10C 12V	a	0	5600	Ant1	5599.96	-40000	-7.14	25	Pass
0C 12V	a	0	5600	Ant1	5599.98	-20000	-3.57	25	Pass
10C 12V	a	0	5600	Ant1	5599.98	-20000	-3.57	25	Pass
30C 12V	a	0	5600	Ant1	5599.96	-40000	-7.14	25	Pass
40C 12V	a	0	5600	Ant1	5599.98	-20000	-3.57	25	Pass

50C 12V	a	0	5600	Ant1	5599.98	-20000	-3.57	25	Pass
20C 10.2V	a	0	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 12V	a	0	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 13.8V	a	0	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-20C 12V	a	0	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-10C 12V	a	0	5700	Ant1	5700	0	0	25	Pass
0C 12V	a	0	5700	Ant1	5700	0	0	25	Pass
10C 12V	a	0	5700	Ant1	5700	0	0	25	Pass
30C 12V	a	0	5700	Ant1	5699.98	-20000	-3.51	25	Pass
40C 12V	a	0	5700	Ant1	5700	0	0	25	Pass
50C 12V	a	0	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 10.2V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 12V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 13.8V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-20C 12V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 12V	a	0	5745	Ant1	5745	0	0	25	Pass
0C 12V	a	0	5745	Ant1	5744.96	-40000	-6.96	25	Pass
10C 12V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
30C 12V	a	0	5745	Ant1	5744.96	-40000	-6.96	25	Pass
40C 12V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
50C 12V	a	0	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 10.2V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
20C 12V	a	0	5785	Ant1	5785	0	0	25	Pass
20C 13.8V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
-20C 12V	a	0	5785	Ant1	5785	0	0	25	Pass
-10C 12V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
0C 12V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
10C 12V	a	0	5785	Ant1	5785	0	0	25	Pass
30C 12V	a	0	5785	Ant1	5784.98	-20000	-3.46	25	Pass
40C 12V	a	0	5785	Ant1	5784.96	-40000	-6.91	25	Pass
50C 12V	a	0	5785	Ant1	5785	0	0	25	Pass
20C 10.2V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 12V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 13.8V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 12V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 12V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 12V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 12V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
30C 12V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 12V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
50C 12V	a	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 10.2V	a	0	5180	Ant2	5180	0	0	25	Pass

20C 12V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 13.8V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
-20C 12V	a	0	5180	Ant2	5180	0	0	25	Pass
-10C 12V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
0C 12V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
10C 12V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
30C 12V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
40C 12V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
50C 12V	a	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 10.2V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
20C 12V	a	0	5200	Ant2	5199.96	-40000	-7.69	25	Pass
20C 13.8V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
-20C 12V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
-10C 12V	a	0	5200	Ant2	5200	0	0	25	Pass
0C 12V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
10C 12V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
30C 12V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
40C 12V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
50C 12V	a	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
20C 10.2V	a	0	5240	Ant2	5240	0	0	25	Pass
20C 12V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 13.8V	a	0	5240	Ant2	5240	0	0	25	Pass
-20C 12V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
-10C 12V	a	0	5240	Ant2	5240	0	0	25	Pass
0C 12V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
10C 12V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
30C 12V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
40C 12V	a	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
50C 12V	a	0	5240	Ant2	5240	0	0	25	Pass
20C 10.2V	a	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
20C 12V	a	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
20C 13.8V	a	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
-20C 12V	a	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
-10C 12V	a	0	5260	Ant2	5259.96	-40000	-7.6	25	Pass
0C 12V	a	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
10C 12V	a	0	5260	Ant2	5259.96	-40000	-7.6	25	Pass
30C 12V	a	0	5260	Ant2	5259.96	-40000	-7.6	25	Pass
40C 12V	a	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
50C 12V	a	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
20C 10.2V	a	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 12V	a	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 13.8V	a	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass

-20C 12V	a	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass
-10C 12V	a	0	5280	Ant2	5280	0	0	25	Pass
0C 12V	a	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass
10C 12V	a	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass
30C 12V	a	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass
40C 12V	a	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass
50C 12V	a	0	5280	Ant2	5279.96	-40000	-7.58	25	Pass
20C 10.2V	a	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
20C 12V	a	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
20C 13.8V	a	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
-20C 12V	a	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
-10C 12V	a	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
0C 12V	a	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
10C 12V	a	0	5320	Ant2	5320	0	0	25	Pass
30C 12V	a	0	5320	Ant2	5320	0	0	25	Pass
40C 12V	a	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
50C 12V	a	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
20C 10.2V	a	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
20C 12V	a	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
20C 13.8V	a	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
-20C 12V	a	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
-10C 12V	a	0	5500	Ant2	5499.96	-40000	-7.27	25	Pass
0C 12V	a	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
10C 12V	a	0	5500	Ant2	5500	0	0	25	Pass
30C 12V	a	0	5500	Ant2	5500	0	0	25	Pass
40C 12V	a	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
50C 12V	a	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
20C 10.2V	a	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
20C 12V	a	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
20C 13.8V	a	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
-20C 12V	a	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
-10C 12V	a	0	5600	Ant2	5600	0	0	25	Pass
0C 12V	a	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
10C 12V	a	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
30C 12V	a	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
40C 12V	a	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
50C 12V	a	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
20C 10.2V	a	0	5700	Ant2	5699.98	-20000	-3.51	25	Pass
20C 12V	a	0	5700	Ant2	5699.98	-20000	-3.51	25	Pass
20C 13.8V	a	0	5700	Ant2	5699.98	-20000	-3.51	25	Pass
-20C 12V	a	0	5700	Ant2	5699.98	-20000	-3.51	25	Pass
-10C 12V	a	0	5700	Ant2	5699.98	-20000	-3.51	25	Pass

0C 12V	a	0	5700	Ant2	5699.98	-20000	-3.51	25	Pass
10C 12V	a	0	5700	Ant2	5699.98	-20000	-3.51	25	Pass
30C 12V	a	0	5700	Ant2	5699.98	-20000	-3.51	25	Pass
40C 12V	a	0	5700	Ant2	5699.98	-20000	-3.51	25	Pass
50C 12V	a	0	5700	Ant2	5700	0	0	25	Pass
20C 10.2V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 12V	a	0	5745	Ant2	5744.96	-40000	-6.96	25	Pass
20C 13.8V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-20C 12V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-10C 12V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
0C 12V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
10C 12V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
30C 12V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
40C 12V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
50C 12V	a	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 10.2V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 12V	a	0	5785	Ant2	5785	0	0	25	Pass
20C 13.8V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
-20C 12V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
-10C 12V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
0C 12V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
10C 12V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
30C 12V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
40C 12V	a	0	5785	Ant2	5785	0	0	25	Pass
50C 12V	a	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
20C 10.2V	a	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
20C 12V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 13.8V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-20C 12V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
-10C 12V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
0C 12V	a	0	5825	Ant2	5825	0	0	25	Pass
10C 12V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
30C 12V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
40C 12V	a	0	5825	Ant2	5824.96	-40000	-6.87	25	Pass
50C 12V	a	0	5825	Ant2	5824.98	-20000	-3.43	25	Pass
20C 10.2V	a	0	5180	Ant3	5180	0	0	25	Pass
20C 12V	a	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
20C 13.8V	a	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
-20C 12V	a	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
-10C 12V	a	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
0C 12V	a	0	5180	Ant3	5179.96	-40000	-7.72	25	Pass
10C 12V	a	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass

30C 12V	a	0	5180	Ant3	5179.96	-40000	-7.72	25	Pass
40C 12V	a	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
50C 12V	a	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
20C 10.2V	a	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
20C 12V	a	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
20C 13.8V	a	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
-20C 12V	a	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
-10C 12V	a	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
0C 12V	a	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
10C 12V	a	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
20C 12V	a	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
30C 12V	a	0	5200	Ant3	5199.96	-40000	-7.69	25	Pass
40C 12V	a	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
50C 12V	a	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
20C 10.2V	a	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
20C 12V	a	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
20C 13.8V	a	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
-20C 12V	a	0	5240	Ant3	5240	0	0	25	Pass
-10C 12V	a	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
0C 12V	a	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
10C 12V	a	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
20C 12V	a	0	5240	Ant3	5239.96	-40000	-7.63	25	Pass
30C 12V	a	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
40C 12V	a	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
50C 12V	a	0	5240	Ant3	5240	0	0	25	Pass
20C 10.2V	a	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
20C 12V	a	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
20C 13.8V	a	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
-20C 12V	a	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
-10C 12V	a	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
0C 12V	a	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
10C 12V	a	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
30C 12V	a	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
40C 12V	a	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
50C 12V	a	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
20C 10.2V	a	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
20C 12V	a	0	5280	Ant3	5280	0	0	25	Pass
20C 13.8V	a	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
-20C 12V	a	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
-10C 12V	a	0	5280	Ant3	5279.96	-40000	-7.58	25	Pass
0C 12V	a	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
10C 12V	a	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass

30C 12V	a	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
40C 12V	a	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
50C 12V	a	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
20C 10.2V	a	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
20C 12V	a	0	5320	Ant3	5319.96	-40000	-7.52	25	Pass
20C 13.8V	a	0	5320	Ant3	5319.96	-40000	-7.52	25	Pass
-20C 12V	a	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
-10C 12V	a	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
0C 12V	a	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
10C 12V	a	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
30C 12V	a	0	5320	Ant3	5319.96	-40000	-7.52	25	Pass
40C 12V	a	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
50C 12V	a	0	5320	Ant3	5319.96	-40000	-7.52	25	Pass
20C 10.2V	a	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
20C 12V	a	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
20C 13.8V	a	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
-20C 12V	a	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
-10C 12V	a	0	5500	Ant3	5499.96	-40000	-7.27	25	Pass
0C 12V	a	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
10C 12V	a	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
30C 12V	a	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
40C 12V	a	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
50C 12V	a	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
20C 10.2V	a	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
20C 12V	a	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
20C 13.8V	a	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
-20C 12V	a	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
-10C 12V	a	0	5600	Ant3	5599.96	-40000	-7.14	25	Pass
0C 12V	a	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
10C 12V	a	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
30C 12V	a	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
40C 12V	a	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
50C 12V	a	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
20C 10.2V	a	0	5700	Ant3	5699.98	-20000	-3.51	25	Pass
20C 12V	a	0	5700	Ant3	5700	0	0	25	Pass
20C 13.8V	a	0	5700	Ant3	5699.98	-20000	-3.51	25	Pass
-20C 12V	a	0	5700	Ant3	5699.98	-20000	-3.51	25	Pass
-10C 12V	a	0	5700	Ant3	5699.98	-20000	-3.51	25	Pass
0C 12V	a	0	5700	Ant3	5699.98	-20000	-3.51	25	Pass
10C 12V	a	0	5700	Ant3	5699.98	-20000	-3.51	25	Pass
30C 12V	a	0	5700	Ant3	5699.98	-20000	-3.51	25	Pass
40C 12V	a	0	5700	Ant3	5699.98	-20000	-3.51	25	Pass

50C 12V	a	0	5700	Ant3	5699.98	-20000	-3.51	25	Pass
20C 10.2V	a	0	5745	Ant3	5744.96	-40000	-6.96	25	Pass
20C 12V	a	0	5745	Ant3	5744.96	-40000	-6.96	25	Pass
20C 13.8V	a	0	5745	Ant3	5744.98	-20000	-3.48	25	Pass
-20C 12V	a	0	5745	Ant3	5744.98	-20000	-3.48	25	Pass
-10C 12V	a	0	5745	Ant3	5744.98	-20000	-3.48	25	Pass
0C 12V	a	0	5745	Ant3	5744.98	-20000	-3.48	25	Pass
10C 12V	a	0	5745	Ant3	5744.98	-20000	-3.48	25	Pass
30C 12V	a	0	5745	Ant3	5744.98	-20000	-3.48	25	Pass
40C 12V	a	0	5745	Ant3	5745	0	0	25	Pass
50C 12V	a	0	5745	Ant3	5744.98	-20000	-3.48	25	Pass
20C 10.2V	a	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
20C 12V	a	0	5785	Ant3	5785	0	0	25	Pass
20C 13.8V	a	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
-20C 12V	a	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
-10C 12V	a	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
0C 12V	a	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
10C 12V	a	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
30C 12V	a	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
40C 12V	a	0	5785	Ant3	5784.96	-40000	-6.91	25	Pass
50C 12V	a	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
20C 10.2V	a	0	5825	Ant3	5824.98	-20000	-3.43	25	Pass
20C 12V	a	0	5825	Ant3	5824.98	-20000	-3.43	25	Pass
20C 13.8V	a	0	5825	Ant3	5824.98	-20000	-3.43	25	Pass
-20C 12V	a	0	5825	Ant3	5824.98	-20000	-3.43	25	Pass
-10C 12V	a	0	5825	Ant3	5824.98	-20000	-3.43	25	Pass
0C 12V	a	0	5825	Ant3	5824.98	-20000	-3.43	25	Pass
10C 12V	a	0	5825	Ant3	5824.98	-20000	-3.43	25	Pass
30C 12V	a	0	5825	Ant3	5824.98	-20000	-3.43	25	Pass
40C 12V	a	0	5825	Ant3	5824.96	-40000	-6.87	25	Pass
50C 12V	a	0	5825	Ant3	5824.96	-40000	-6.87	25	Pass
20C 10.2V	n20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 12V	n20	0	5180	Ant1	5180	0	0	25	Pass
20C 13.8V	n20	0	5180	Ant1	5180	0	0	25	Pass
-20C 12V	n20	0	5180	Ant1	5180	0	0	25	Pass
-10C 12V	n20	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
0C 12V	n20	0	5180	Ant1	5179.96	-40000	-7.72	25	Pass
10C 12V	n20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
30C 12V	n20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 12V	n20	0	5180	Ant1	5179.98	-20000	-3.86	25	Pass
50C 12V	n20	0	5180	Ant1	5180	0	0	25	Pass
20C 10.2V	n20	0	5200	Ant1	5200	0	0	25	Pass

20C 12V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
20C 13.8V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-20C 12V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
-10C 12V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
0C 12V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
10C 12V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
30C 12V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
40C 12V	n20	0	5200	Ant1	5199.98	-20000	-3.85	25	Pass
50C 12V	n20	0	5200	Ant1	5200	0	0	25	Pass
20C 10.2V	n20	0	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 12V	n20	0	5240	Ant1	5240	0	0	25	Pass
20C 13.8V	n20	0	5240	Ant1	5240	0	0	25	Pass
-20C 12V	n20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 12V	n20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 12V	n20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 12V	n20	0	5240	Ant1	5240	0	0	25	Pass
30C 12V	n20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 12V	n20	0	5240	Ant1	5239.96	-40000	-7.63	25	Pass
50C 12V	n20	0	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 10.2V	n20	0	5260	Ant1	5260	0	0	25	Pass
20C 12V	n20	0	5260	Ant1	5260	0	0	25	Pass
20C 13.8V	n20	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 12V	n20	0	5260	Ant1	5260	0	0	25	Pass
-10C 12V	n20	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 12V	n20	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
10C 12V	n20	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
30C 12V	n20	0	5260	Ant1	5260	0	0	25	Pass
40C 12V	n20	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
50C 12V	n20	0	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 10.2V	n20	0	5280	Ant1	5280	0	0	25	Pass
20C 12V	n20	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 13.8V	n20	0	5280	Ant1	5280	0	0	25	Pass
-20C 12V	n20	0	5280	Ant1	5280	0	0	25	Pass
-10C 12V	n20	0	5280	Ant1	5280	0	0	25	Pass
0C 12V	n20	0	5280	Ant1	5280	0	0	25	Pass
10C 12V	n20	0	5280	Ant1	5280	0	0	25	Pass
30C 12V	n20	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 12V	n20	0	5280	Ant1	5280	0	0	25	Pass
50C 12V	n20	0	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 10.2V	n20	0	5320	Ant1	5320	0	0	25	Pass
20C 12V	n20	0	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 13.8V	n20	0	5320	Ant1	5320	0	0	25	Pass

-20C 12V	n20	0	5320	Ant1	5320	0	0	25	Pass
-10C 12V	n20	0	5320	Ant1	5320	0	0	25	Pass
0C 12V	n20	0	5320	Ant1	5320	0	0	25	Pass
10C 12V	n20	0	5320	Ant1	5320	0	0	25	Pass
30C 12V	n20	0	5320	Ant1	5320	0	0	25	Pass
40C 12V	n20	0	5320	Ant1	5320	0	0	25	Pass
50C 12V	n20	0	5320	Ant1	5320	0	0	25	Pass
20C 10.2V	n20	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 12V	n20	0	5500	Ant1	5500	0	0	25	Pass
20C 13.8V	n20	0	5500	Ant1	5500	0	0	25	Pass
-20C 12V	n20	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-10C 12V	n20	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
0C 12V	n20	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
10C 12V	n20	0	5500	Ant1	5500	0	0	25	Pass
30C 12V	n20	0	5500	Ant1	5500	0	0	25	Pass
40C 12V	n20	0	5500	Ant1	5499.98	-20000	-3.64	25	Pass
50C 12V	n20	0	5500	Ant1	5500	0	0	25	Pass
20C 10.2V	n20	0	5600	Ant1	5600	0	0	25	Pass
20C 12V	n20	0	5600	Ant1	5600	0	0	25	Pass
20C 13.8V	n20	0	5600	Ant1	5600	0	0	25	Pass
-20C 12V	n20	0	5600	Ant1	5599.98	-20000	-3.57	25	Pass
-10C 12V	n20	0	5600	Ant1	5600	0	0	25	Pass
0C 12V	n20	0	5600	Ant1	5600	0	0	25	Pass
10C 12V	n20	0	5600	Ant1	5600	0	0	25	Pass
30C 12V	n20	0	5600	Ant1	5600	0	0	25	Pass
40C 12V	n20	0	5600	Ant1	5599.98	-20000	-3.57	25	Pass
50C 12V	n20	0	5600	Ant1	5600	0	0	25	Pass
20C 10.2V	n20	0	5700	Ant1	5700	0	0	25	Pass
20C 12V	n20	0	5700	Ant1	5700	0	0	25	Pass
20C 13.8V	n20	0	5700	Ant1	5700.02	20000	3.51	25	Pass
-20C 12V	n20	0	5700	Ant1	5700.02	20000	3.51	25	Pass
-10C 12V	n20	0	5700	Ant1	5700.02	20000	3.51	25	Pass
0C 12V	n20	0	5700	Ant1	5700	0	0	25	Pass
10C 12V	n20	0	5700	Ant1	5700	0	0	25	Pass
30C 12V	n20	0	5700	Ant1	5700	0	0	25	Pass
40C 12V	n20	0	5700	Ant1	5700	0	0	25	Pass
50C 12V	n20	0	5700	Ant1	5700	0	0	25	Pass
20C 10.2V	n20	0	5745	Ant1	5745	0	0	25	Pass
20C 12V	n20	0	5745	Ant1	5745	0	0	25	Pass
20C 13.8V	n20	0	5745	Ant1	5745.02	20000	3.48	25	Pass
-20C 12V	n20	0	5745	Ant1	5745.02	20000	3.48	25	Pass
-10C 12V	n20	0	5745	Ant1	5745	0	0	25	Pass

0C 12V	n20	0	5745	Ant1	5745	0	0	25	Pass
10C 12V	n20	0	5745	Ant1	5745	0	0	25	Pass
30C 12V	n20	0	5745	Ant1	5745	0	0	25	Pass
40C 12V	n20	0	5745	Ant1	5745	0	0	25	Pass
50C 12V	n20	0	5745	Ant1	5745	0	0	25	Pass
20C 10.2V	n20	0	5785	Ant1	5785	0	0	25	Pass
20C 12V	n20	0	5785	Ant1	5785	0	0	25	Pass
20C 13.8V	n20	0	5785	Ant1	5785	0	0	25	Pass
-20C 12V	n20	0	5785	Ant1	5785	0	0	25	Pass
-10C 12V	n20	0	5785	Ant1	5785	0	0	25	Pass
0C 12V	n20	0	5785	Ant1	5785.02	20000	3.46	25	Pass
10C 12V	n20	0	5785	Ant1	5785	0	0	25	Pass
30C 12V	n20	0	5785	Ant1	5785.02	20000	3.46	25	Pass
40C 12V	n20	0	5785	Ant1	5785	0	0	25	Pass
50C 12V	n20	0	5785	Ant1	5785	0	0	25	Pass
20C 10.2V	n20	0	5825	Ant1	5825	0	0	25	Pass
20C 12V	n20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 13.8V	n20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 12V	n20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-10C 12V	n20	0	5825	Ant1	5825	0	0	25	Pass
0C 12V	n20	0	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 12V	n20	0	5825	Ant1	5825	0	0	25	Pass
30C 12V	n20	0	5825	Ant1	5825	0	0	25	Pass
40C 12V	n20	0	5825	Ant1	5825	0	0	25	Pass
50C 12V	n20	0	5825	Ant1	5825	0	0	25	Pass
20C 10.2V	n20	0	5180	Ant2	5180	0	0	25	Pass
20C 12V	n20	0	5180	Ant2	5180	0	0	25	Pass
20C 13.8V	n20	0	5180	Ant2	5180	0	0	25	Pass
-20C 12V	n20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
-10C 12V	n20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
0C 12V	n20	0	5180	Ant2	5180	0	0	25	Pass
10C 12V	n20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
30C 12V	n20	0	5180	Ant2	5180	0	0	25	Pass
40C 12V	n20	0	5180	Ant2	5180	0	0	25	Pass
50C 12V	n20	0	5180	Ant2	5179.98	-20000	-3.86	25	Pass
20C 10.2V	n20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
20C 12V	n20	0	5200	Ant2	5200	0	0	25	Pass
20C 13.8V	n20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
-20C 12V	n20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
-10C 12V	n20	0	5200	Ant2	5200	0	0	25	Pass
0C 12V	n20	0	5200	Ant2	5200	0	0	25	Pass
10C 12V	n20	0	5200	Ant2	5200	0	0	25	Pass

30C 12V	n20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
40C 12V	n20	0	5200	Ant2	5200	0	0	25	Pass
50C 12V	n20	0	5200	Ant2	5199.98	-20000	-3.85	25	Pass
20C 10.2V	n20	0	5240	Ant2	5240	0	0	25	Pass
20C 12V	n20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 13.8V	n20	0	5240	Ant2	5240	0	0	25	Pass
-20C 12V	n20	0	5240	Ant2	5240	0	0	25	Pass
-10C 12V	n20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
0C 12V	n20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
10C 12V	n20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
30C 12V	n20	0	5240	Ant2	5240	0	0	25	Pass
40C 12V	n20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
50C 12V	n20	0	5240	Ant2	5239.98	-20000	-3.82	25	Pass
20C 10.2V	n20	0	5260	Ant2	5260	0	0	25	Pass
20C 12V	n20	0	5260	Ant2	5260	0	0	25	Pass
20C 13.8V	n20	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
-20C 12V	n20	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
-10C 12V	n20	0	5260	Ant2	5260	0	0	25	Pass
0C 12V	n20	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
10C 12V	n20	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
30C 12V	n20	0	5260	Ant2	5259.98	-20000	-3.8	25	Pass
40C 12V	n20	0	5260	Ant2	5260.02	20000	3.8	25	Pass
50C 12V	n20	0	5260	Ant2	5260	0	0	25	Pass
20C 10.2V	n20	0	5280	Ant2	5280	0	0	25	Pass
20C 12V	n20	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass
20C 13.8V	n20	0	5280	Ant2	5279.96	-40000	-7.58	25	Pass
-20C 12V	n20	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass
-10C 12V	n20	0	5280	Ant2	5279.96	-40000	-7.58	25	Pass
0C 12V	n20	0	5280	Ant2	5279.98	-20000	-3.79	25	Pass
10C 12V	n20	0	5280	Ant2	5280	0	0	25	Pass
30C 12V	n20	0	5280	Ant2	5280	0	0	25	Pass
40C 12V	n20	0	5280	Ant2	5280	0	0	25	Pass
50C 12V	n20	0	5280	Ant2	5280	0	0	25	Pass
20C 10.2V	n20	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
20C 12V	n20	0	5320	Ant2	5320	0	0	25	Pass
20C 13.8V	n20	0	5320	Ant2	5320	0	0	25	Pass
-20C 12V	n20	0	5320	Ant2	5319.96	-40000	-7.52	25	Pass
-10C 12V	n20	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
0C 12V	n20	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
10C 12V	n20	0	5320	Ant2	5320	0	0	25	Pass
30C 12V	n20	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
40C 12V	n20	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass

50C 12V	n20	0	5320	Ant2	5319.98	-20000	-3.76	25	Pass
20C 10.2V	n20	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
20C 12V	n20	0	5500	Ant2	5500	0	0	25	Pass
20C 13.8V	n20	0	5500	Ant2	5500	0	0	25	Pass
-20C 12V	n20	0	5500	Ant2	5500	0	0	25	Pass
-10C 12V	n20	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
0C 12V	n20	0	5500	Ant2	5500	0	0	25	Pass
10C 12V	n20	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
30C 12V	n20	0	5500	Ant2	5499.98	-20000	-3.64	25	Pass
40C 12V	n20	0	5500	Ant2	5500	0	0	25	Pass
50C 12V	n20	0	5500	Ant2	5500	0	0	25	Pass
20C 10.2V	n20	0	5600	Ant2	5600	0	0	25	Pass
20C 12V	n20	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
20C 13.8V	n20	0	5600	Ant2	5600	0	0	25	Pass
-20C 12V	n20	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
-10C 12V	n20	0	5600	Ant2	5600	0	0	25	Pass
0C 12V	n20	0	5600	Ant2	5600	0	0	25	Pass
10C 12V	n20	0	5600	Ant2	5600	0	0	25	Pass
30C 12V	n20	0	5600	Ant2	5599.98	-20000	-3.57	25	Pass
40C 12V	n20	0	5600	Ant2	5600	0	0	25	Pass
50C 12V	n20	0	5600	Ant2	5600	0	0	25	Pass
20C 10.2V	n20	0	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 12V	n20	0	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 13.8V	n20	0	5700	Ant2	5700	0	0	25	Pass
-20C 12V	n20	0	5700	Ant2	5700.02	20000	3.51	25	Pass
-10C 12V	n20	0	5700	Ant2	5700	0	0	25	Pass
0C 12V	n20	0	5700	Ant2	5700	0	0	25	Pass
10C 12V	n20	0	5700	Ant2	5700	0	0	25	Pass
30C 12V	n20	0	5700	Ant2	5700	0	0	25	Pass
40C 12V	n20	0	5700	Ant2	5700	0	0	25	Pass
50C 12V	n20	0	5700	Ant2	5700	0	0	25	Pass
20C 10.2V	n20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 12V	n20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
20C 13.8V	n20	0	5745	Ant2	5745	0	0	25	Pass
-20C 12V	n20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
-10C 12V	n20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
0C 12V	n20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
10C 12V	n20	0	5745	Ant2	5745	0	0	25	Pass
30C 12V	n20	0	5745	Ant2	5744.98	-20000	-3.48	25	Pass
40C 12V	n20	0	5745	Ant2	5745	0	0	25	Pass
50C 12V	n20	0	5745	Ant2	5745	0	0	25	Pass
20C 10.2V	n20	0	5785	Ant2	5785	0	0	25	Pass

20C 12V	n20	0	5785	Ant2	5785	0	0	25	Pass
20C 13.8V	n20	0	5785	Ant2	5785	0	0	25	Pass
-20C 12V	n20	0	5785	Ant2	5785	0	0	25	Pass
-10C 12V	n20	0	5785	Ant2	5785	0	0	25	Pass
0C 12V	n20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
10C 12V	n20	0	5785	Ant2	5785	0	0	25	Pass
30C 12V	n20	0	5785	Ant2	5785	0	0	25	Pass
40C 12V	n20	0	5785	Ant2	5784.98	-20000	-3.46	25	Pass
50C 12V	n20	0	5785	Ant2	5785	0	0	25	Pass
20C 10.2V	n20	0	5825	Ant2	5825	0	0	25	Pass
20C 12V	n20	0	5825	Ant2	5825	0	0	25	Pass
20C 13.8V	n20	0	5825	Ant2	5825	0	0	25	Pass
-20C 12V	n20	0	5825	Ant2	5825	0	0	25	Pass
-10C 12V	n20	0	5825	Ant2	5825	0	0	25	Pass
0C 12V	n20	0	5825	Ant2	5825	0	0	25	Pass
10C 12V	n20	0	5825	Ant2	5825	0	0	25	Pass
30C 12V	n20	0	5825	Ant2	5825	0	0	25	Pass
40C 12V	n20	0	5825	Ant2	5825	0	0	25	Pass
50C 12V	n20	0	5825	Ant2	5825	0	0	25	Pass
20C 10.2V	n20	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
20C 12V	n20	0	5180	Ant3	5179.96	-40000	-7.72	25	Pass
20C 13.8V	n20	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
-20C 12V	n20	0	5180	Ant3	5180	0	0	25	Pass
-10C 12V	n20	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
0C 12V	n20	0	5180	Ant3	5180	0	0	25	Pass
10C 12V	n20	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
30C 12V	n20	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
40C 12V	n20	0	5180	Ant3	5180	0	0	25	Pass
50C 12V	n20	0	5180	Ant3	5179.98	-20000	-3.86	25	Pass
20C 10.2V	n20	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
20C 12V	n20	0	5200	Ant3	5200	0	0	25	Pass
20C 13.8V	n20	0	5200	Ant3	5200	0	0	25	Pass
-20C 12V	n20	0	5200	Ant3	5200	0	0	25	Pass
-10C 12V	n20	0	5200	Ant3	5200	0	0	25	Pass
0C 12V	n20	0	5200	Ant3	5200	0	0	25	Pass
10C 12V	n20	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
30C 12V	n20	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
40C 12V	n20	0	5200	Ant3	5200	0	0	25	Pass
50C 12V	n20	0	5200	Ant3	5199.98	-20000	-3.85	25	Pass
20C 10.2V	n20	0	5240	Ant3	5240	0	0	25	Pass
20C 12V	n20	0	5240	Ant3	5240	0	0	25	Pass
20C 13.8V	n20	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass

-20C 12V	n20	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
-10C 12V	n20	0	5240	Ant3	5240	0	0	25	Pass
0C 12V	n20	0	5240	Ant3	5240	0	0	25	Pass
10C 12V	n20	0	5240	Ant3	5240	0	0	25	Pass
30C 12V	n20	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
40C 12V	n20	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
50C 12V	n20	0	5240	Ant3	5239.98	-20000	-3.82	25	Pass
20C 10.2V	n20	0	5260	Ant3	5260	0	0	25	Pass
20C 12V	n20	0	5260	Ant3	5260	0	0	25	Pass
20C 13.8V	n20	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
-20C 12V	n20	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
-10C 12V	n20	0	5260	Ant3	5260	0	0	25	Pass
0C 12V	n20	0	5260	Ant3	5260	0	0	25	Pass
10C 12V	n20	0	5260	Ant3	5260	0	0	25	Pass
30C 12V	n20	0	5260	Ant3	5259.98	-20000	-3.8	25	Pass
40C 12V	n20	0	5260	Ant3	5260	0	0	25	Pass
50C 12V	n20	0	5260	Ant3	5260	0	0	25	Pass
20C 10.2V	n20	0	5280	Ant3	5280	0	0	25	Pass
20C 12V	n20	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
20C 13.8V	n20	0	5280	Ant3	5280	0	0	25	Pass
-20C 12V	n20	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
-10C 12V	n20	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
0C 12V	n20	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
10C 12V	n20	0	5280	Ant3	5280	0	0	25	Pass
30C 12V	n20	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
40C 12V	n20	0	5280	Ant3	5280.02	20000	3.79	25	Pass
50C 12V	n20	0	5280	Ant3	5279.98	-20000	-3.79	25	Pass
20C 10.2V	n20	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
20C 12V	n20	0	5320	Ant3	5320	0	0	25	Pass
20C 13.8V	n20	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
-20C 12V	n20	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
-10C 12V	n20	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
0C 12V	n20	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
10C 12V	n20	0	5320	Ant3	5319.98	-20000	-3.76	25	Pass
30C 12V	n20	0	5320	Ant3	5320	0	0	25	Pass
40C 12V	n20	0	5320	Ant3	5319.96	-40000	-7.52	25	Pass
50C 12V	n20	0	5320	Ant3	5320	0	0	25	Pass
20C 10.2V	n20	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
20C 12V	n20	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
20C 13.8V	n20	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
-20C 12V	n20	0	5500	Ant3	5499.96	-40000	-7.27	25	Pass
-10C 12V	n20	0	5500	Ant3	5500	0	0	25	Pass

0C 12V	n20	0	5500	Ant3	5499.98	-20000	-3.64	25	Pass
10C 12V	n20	0	5500	Ant3	5500	0	0	25	Pass
30C 12V	n20	0	5500	Ant3	5500	0	0	25	Pass
40C 12V	n20	0	5500	Ant3	5500	0	0	25	Pass
50C 12V	n20	0	5500	Ant3	5500	0	0	25	Pass
20C 10.2V	n20	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
20C 12V	n20	0	5600	Ant3	5600	0	0	25	Pass
20C 13.8V	n20	0	5600	Ant3	5600	0	0	25	Pass
-20C 12V	n20	0	5600	Ant3	5599.98	-20000	-3.57	25	Pass
-10C 12V	n20	0	5600	Ant3	5600	0	0	25	Pass
0C 12V	n20	0	5600	Ant3	5600	0	0	25	Pass
10C 12V	n20	0	5600	Ant3	5600	0	0	25	Pass
30C 12V	n20	0	5600	Ant3	5600	0	0	25	Pass
40C 12V	n20	0	5600	Ant3	5600	0	0	25	Pass
50C 12V	n20	0	5600	Ant3	5600	0	0	25	Pass
20C 10.2V	n20	-18	5700	Ant3	5700	0	0	25	Pass
20C 12V	n20	-18	5700	Ant3	5700.02	20000	3.51	25	Pass
20C 13.8V	n20	-18	5700	Ant3	5700.02	20000	3.51	25	Pass
-20C 12V	n20	-18	5700	Ant3	5700.02	20000	3.51	25	Pass
-10C 12V	n20	-18	5700	Ant3	5700	0	0	25	Pass
0C 12V	n20	-18	5700	Ant3	5700.02	20000	3.51	25	Pass
10C 12V	n20	-18	5700	Ant3	5700	0	0	25	Pass
30C 12V	n20	-18	5700	Ant3	5700.02	20000	3.51	25	Pass
40C 12V	n20	-18	5700	Ant3	5700.04	40000	7.02	25	Pass
50C 12V	n20	-18	5700	Ant3	5700	0	0	25	Pass
20C 10.2V	n20	0	5745	Ant3	5745	0	0	25	Pass
20C 12V	n20	0	5745	Ant3	5745	0	0	25	Pass
20C 13.8V	n20	0	5745	Ant3	5744.98	-20000	-3.48	25	Pass
-20C 12V	n20	0	5745	Ant3	5745	0	0	25	Pass
-10C 12V	n20	0	5745	Ant3	5744.98	-20000	-3.48	25	Pass
0C 12V	n20	0	5745	Ant3	5745	0	0	25	Pass
10C 12V	n20	0	5745	Ant3	5745	0	0	25	Pass
30C 12V	n20	0	5745	Ant3	5745	0	0	25	Pass
40C 12V	n20	0	5745	Ant3	5745	0	0	25	Pass
50C 12V	n20	0	5745	Ant3	5745	0	0	25	Pass
20C 10.2V	n20	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
20C 12V	n20	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
20C 13.8V	n20	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
-20C 12V	n20	0	5785	Ant3	5785	0	0	25	Pass
-10C 12V	n20	0	5785	Ant3	5785	0	0	25	Pass
0C 12V	n20	0	5785	Ant3	5785	0	0	25	Pass
10C 12V	n20	0	5785	Ant3	5785	0	0	25	Pass

30C 12V	n20	0	5785	Ant3	5785	0	0	25	Pass
40C 12V	n20	0	5785	Ant3	5784.98	-20000	-3.46	25	Pass
50C 12V	n20	0	5785	Ant3	5785	0	0	25	Pass
20C 10.2V	n20	0	5825	Ant3	5825	0	0	25	Pass
20C 12V	n20	0	5825	Ant3	5825	0	0	25	Pass
20C 13.8V	n20	0	5825	Ant3	5825	0	0	25	Pass
-20C 12V	n20	0	5825	Ant3	5825	0	0	25	Pass
-10C 12V	n20	0	5825	Ant3	5824.98	-20000	-3.43	25	Pass
0C 12V	n20	0	5825	Ant3	5824.98	-20000	-3.43	25	Pass
10C 12V	n20	0	5825	Ant3	5825	0	0	25	Pass
20C 12V	n20	0	5825	Ant3	5825	0	0	25	Pass
30C 12V	n20	0	5825	Ant3	5825	0	0	25	Pass
40C 12V	n20	0	5825	Ant3	5825	0	0	25	Pass
50C 12V	n20	0	5825	Ant3	5825	0	0	25	Pass
20C 10.2V	n40	0	5190	Ant1	5190	0	0	25	Pass
20C 12V	n40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 13.8V	n40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-20C 12V	n40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-10C 12V	n40	0	5190	Ant1	5189.96	-40000	-7.71	25	Pass
0C 12V	n40	0	5190	Ant1	5190	0	0	25	Pass
10C 12V	n40	0	5190	Ant1	5190	0	0	25	Pass
30C 12V	n40	0	5190	Ant1	5190	0	0	25	Pass
40C 12V	n40	0	5190	Ant1	5190	0	0	25	Pass
50C 12V	n40	0	5190	Ant1	5190	0	0	25	Pass
20C 10.2V	n40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 12V	n40	0	5230	Ant1	5230	0	0	25	Pass
20C 13.8V	n40	0	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-20C 12V	n40	0	5230	Ant1	5230	0	0	25	Pass
-10C 12V	n40	0	5230	Ant1	5230	0	0	25	Pass
0C 12V	n40	0	5230	Ant1	5230	0	0	25	Pass
10C 12V	n40	0	5230	Ant1	5230	0	0	25	Pass
30C 12V	n40	0	5230	Ant1	5230	0	0	25	Pass
40C 12V	n40	0	5230	Ant1	5230	0	0	25	Pass
50C 12V	n40	0	5230	Ant1	5230	0	0	25	Pass
20C 10.2V	n40	0	5270	Ant1	5270	0	0	25	Pass
20C 12V	n40	0	5270	Ant1	5270	0	0	25	Pass
20C 13.8V	n40	0	5270	Ant1	5269.96	-40000	-7.59	25	Pass
-20C 12V	n40	0	5270	Ant1	5270	0	0	25	Pass
-10C 12V	n40	0	5270	Ant1	5270	0	0	25	Pass
0C 12V	n40	0	5270	Ant1	5270	0	0	25	Pass
10C 12V	n40	0	5270	Ant1	5270.04	40000	7.59	25	Pass
30C 12V	n40	0	5270	Ant1	5270	0	0	25	Pass

40C 12V	n40	0	5270	Ant1	5270	0	0	25	Pass
50C 12V	n40	0	5270	Ant1	5269.96	-40000	-7.59	25	Pass
20C 10.2V	n40	0	5310	Ant1	5310	0	0	25	Pass
20C 12V	n40	0	5310	Ant1	5310	0	0	25	Pass
20C 13.8V	n40	0	5310	Ant1	5310	0	0	25	Pass
-20C 12V	n40	0	5310	Ant1	5310	0	0	25	Pass
-10C 12V	n40	0	5310	Ant1	5310	0	0	25	Pass
0C 12V	n40	0	5310	Ant1	5310	0	0	25	Pass
10C 12V	n40	0	5310	Ant1	5310	0	0	25	Pass
30C 12V	n40	0	5310	Ant1	5310	0	0	25	Pass
40C 12V	n40	0	5310	Ant1	5310	0	0	25	Pass
50C 12V	n40	0	5310	Ant1	5310	0	0	25	Pass
20C 10.2V	n40	0	5510	Ant1	5510	0	0	25	Pass
20C 12V	n40	0	5510	Ant1	5510	0	0	25	Pass
20C 13.8V	n40	0	5510	Ant1	5509.96	-40000	-7.26	25	Pass
-20C 12V	n40	0	5510	Ant1	5510	0	0	25	Pass
-10C 12V	n40	0	5510	Ant1	5509.96	-40000	-7.26	25	Pass
0C 12V	n40	0	5510	Ant1	5510	0	0	25	Pass
10C 12V	n40	0	5510	Ant1	5509.96	-40000	-7.26	25	Pass
30C 12V	n40	0	5510	Ant1	5510	0	0	25	Pass
40C 12V	n40	0	5510	Ant1	5510	0	0	25	Pass
50C 12V	n40	0	5510	Ant1	5510	0	0	25	Pass
20C 10.2V	n40	0	5590	Ant1	5589.96	-40000	-7.16	25	Pass
20C 12V	n40	0	5590	Ant1	5590	0	0	25	Pass
20C 13.8V	n40	0	5590	Ant1	5590	0	0	25	Pass
-20C 12V	n40	0	5590	Ant1	5590	0	0	25	Pass
-10C 12V	n40	0	5590	Ant1	5590	0	0	25	Pass
0C 12V	n40	0	5590	Ant1	5590	0	0	25	Pass
10C 12V	n40	0	5590	Ant1	5590	0	0	25	Pass
30C 12V	n40	0	5590	Ant1	5590	0	0	25	Pass
40C 12V	n40	0	5590	Ant1	5589.96	-40000	-7.16	25	Pass
50C 12V	n40	0	5590	Ant1	5590	0	0	25	Pass
20C 10.2V	n40	0	5670	Ant1	5670	0	0	25	Pass
20C 12V	n40	0	5670	Ant1	5669.96	-40000	-7.05	25	Pass
20C 13.8V	n40	0	5670	Ant1	5670	0	0	25	Pass
-20C 12V	n40	0	5670	Ant1	5669.96	-40000	-7.05	25	Pass
-10C 12V	n40	0	5670	Ant1	5670	0	0	25	Pass
0C 12V	n40	0	5670	Ant1	5669.96	-40000	-7.05	25	Pass
10C 12V	n40	0	5670	Ant1	5670	0	0	25	Pass
30C 12V	n40	0	5670	Ant1	5670	0	0	25	Pass
40C 12V	n40	0	5670	Ant1	5669.96	-40000	-7.05	25	Pass
50C 12V	n40	0	5670	Ant1	5670	0	0	25	Pass