


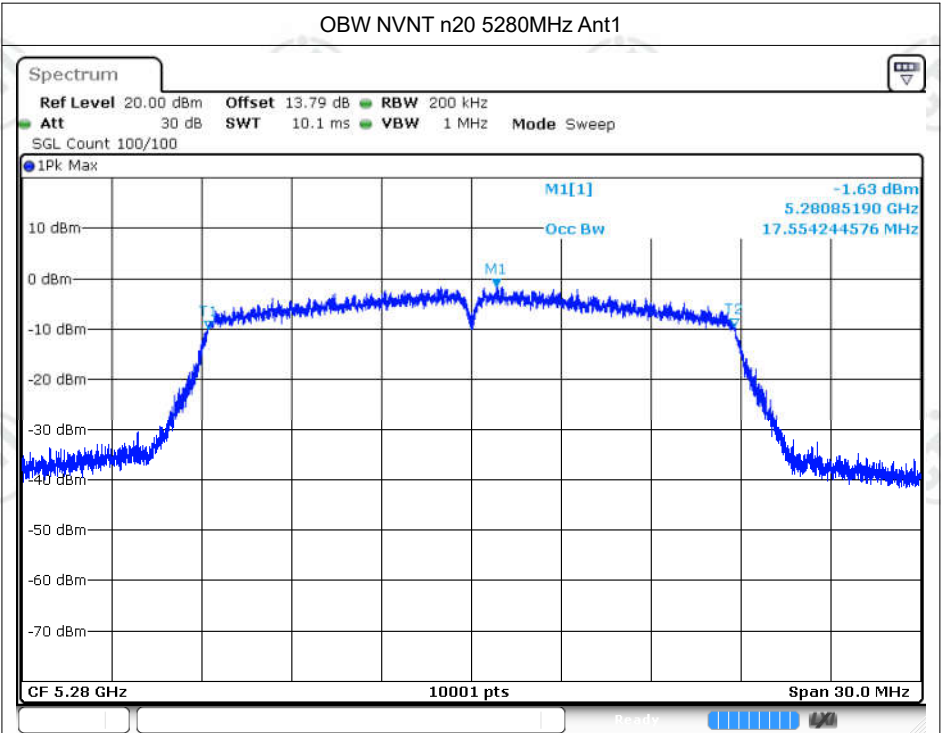


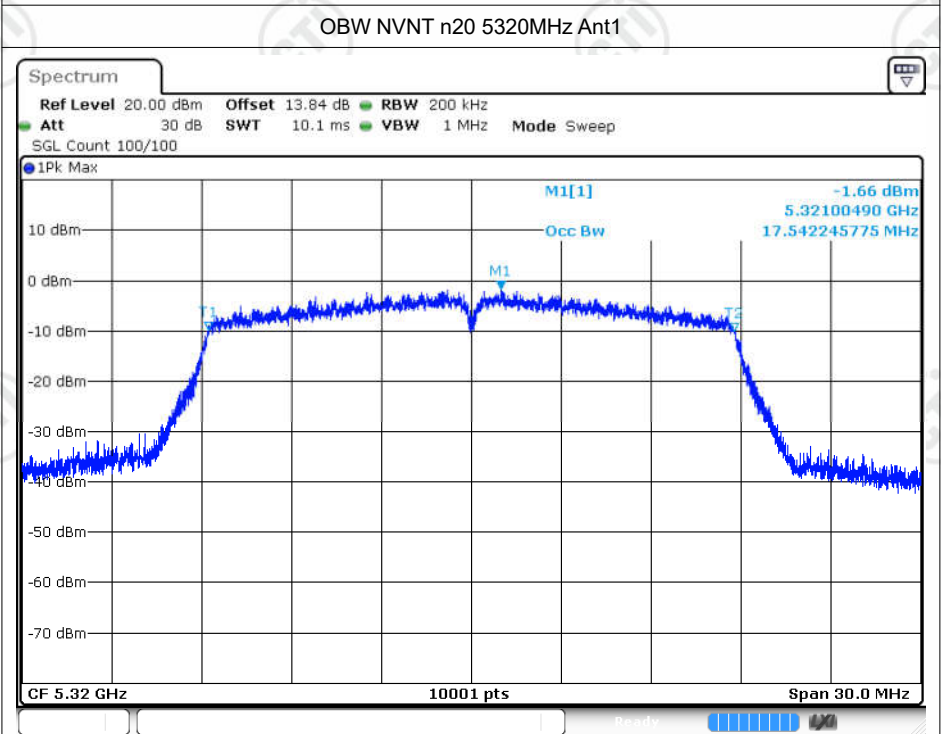


Date: 5.MAY.2024 13:00:52

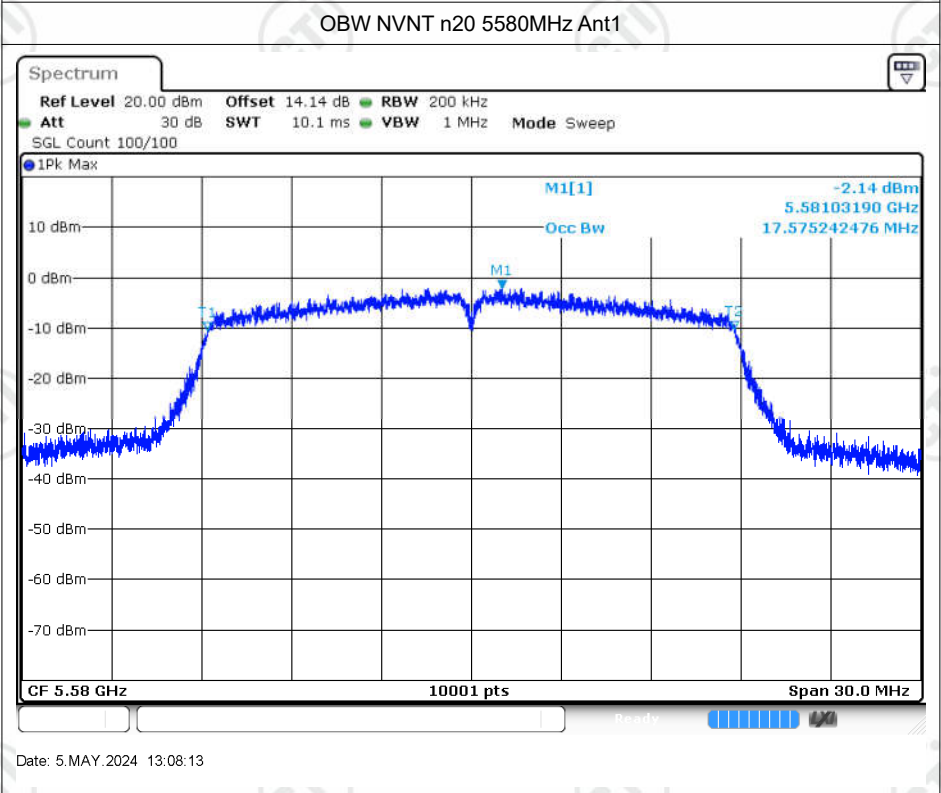


Date: 5.MAY.2024 13:02:47

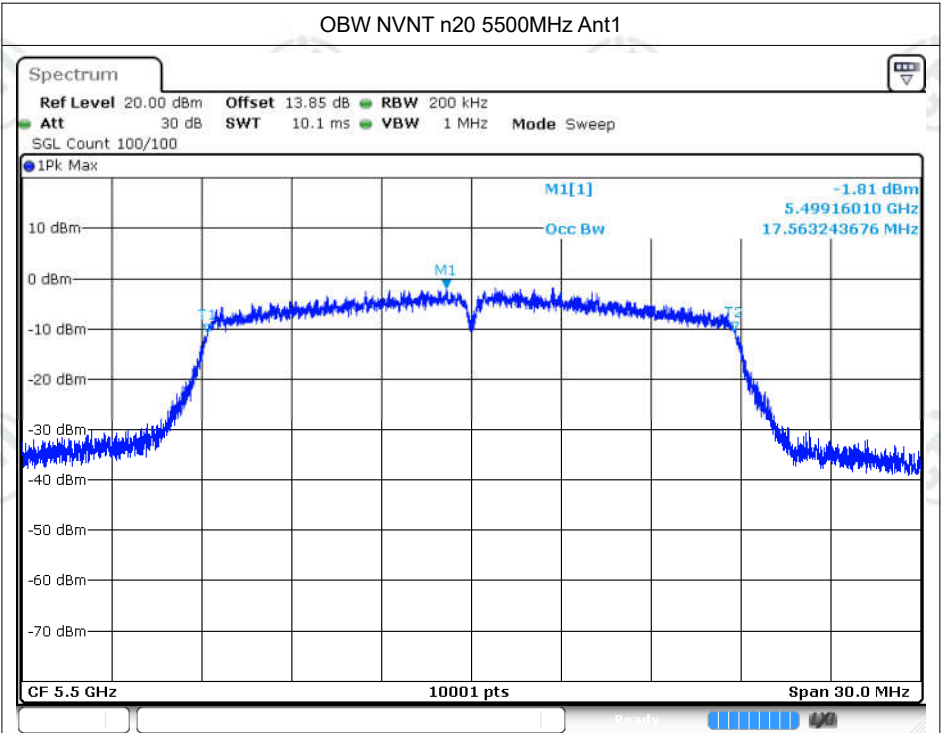


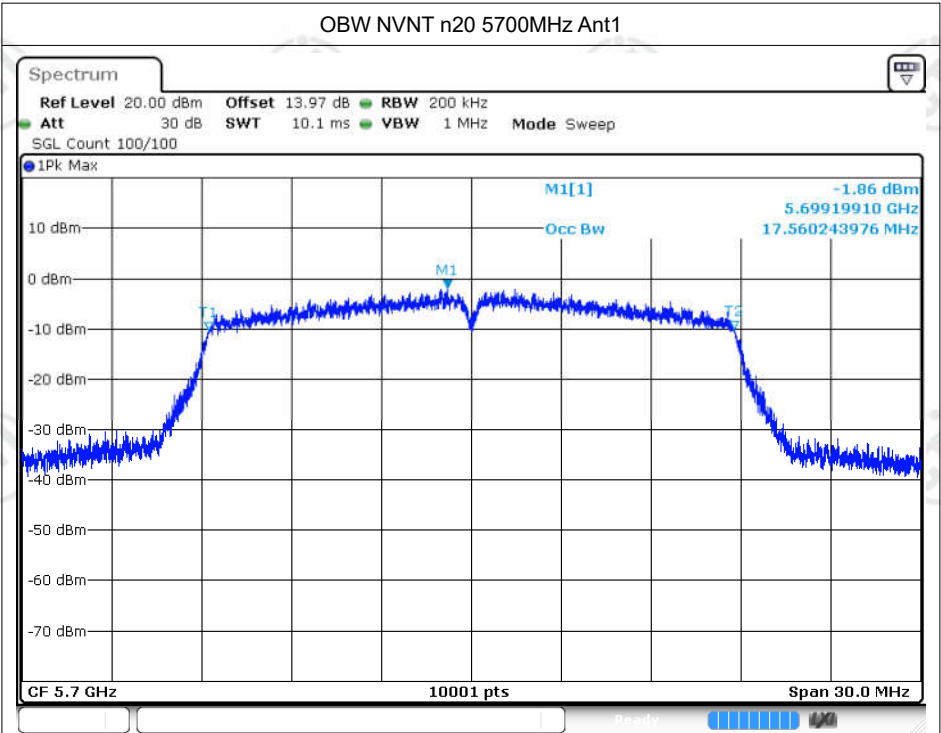


Date: 5.MAY.2024 13:06:57

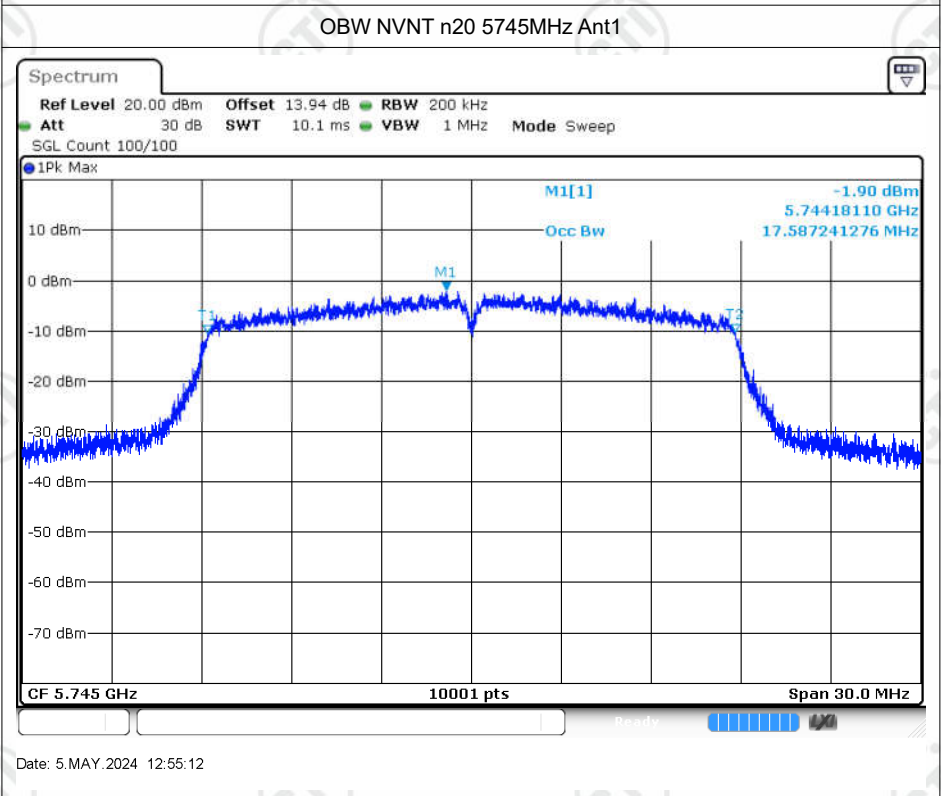


Date: 5.MAY.2024 12:55:12

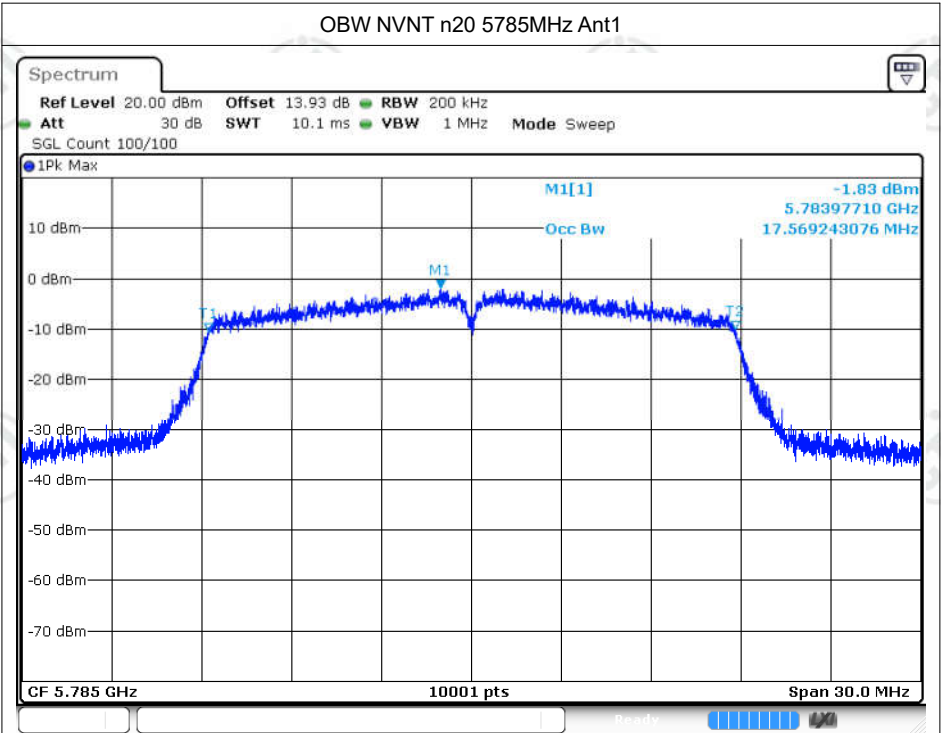


Date: 5.MAY.2024 12:56:43

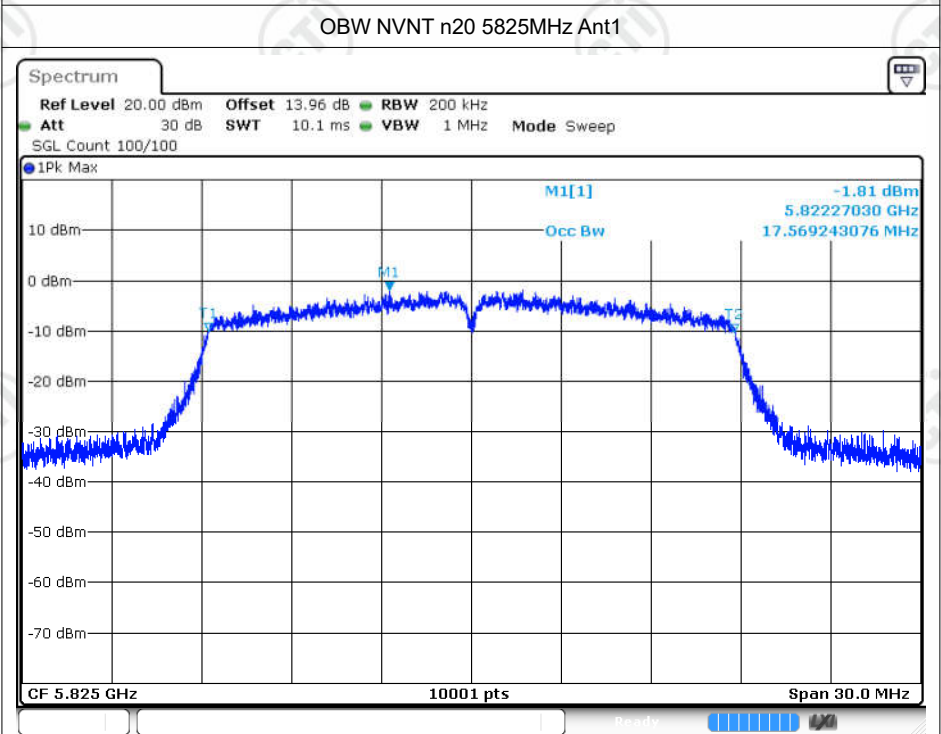


Date: 5.MAY.2024 12:57:43

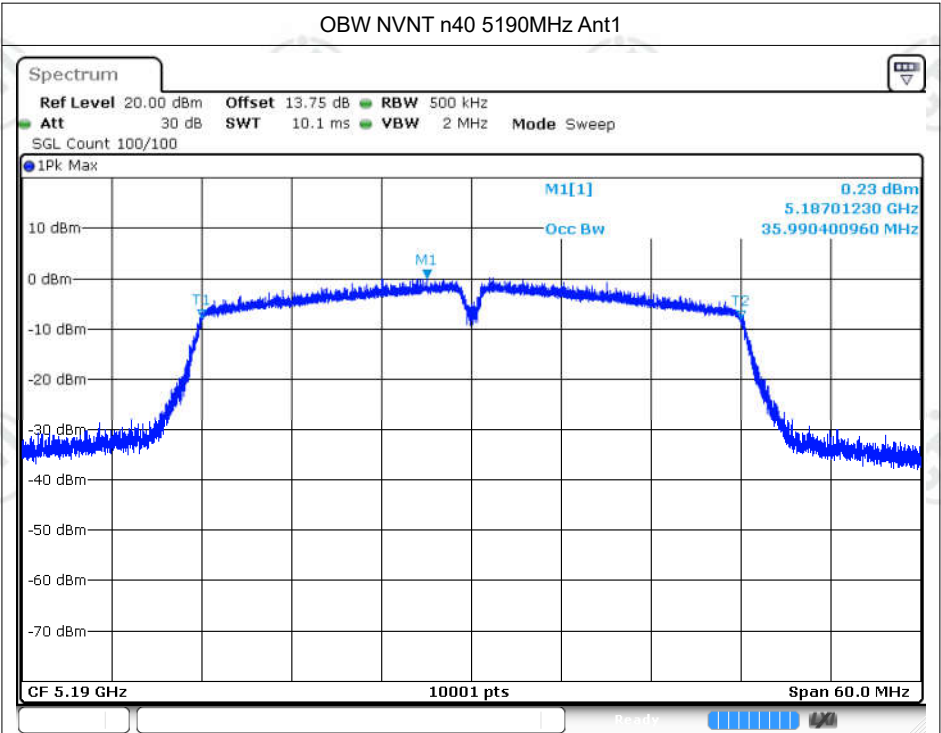


Date: 5.MAY.2024 13:10:25

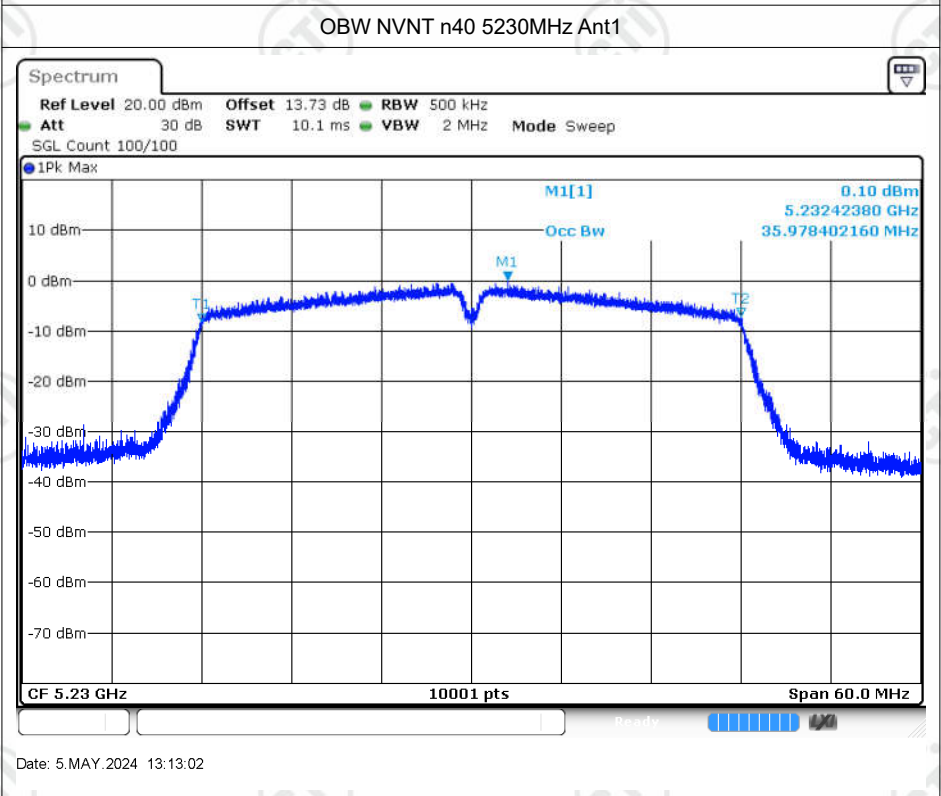


Date: 5.MAY.2024 13:13:02

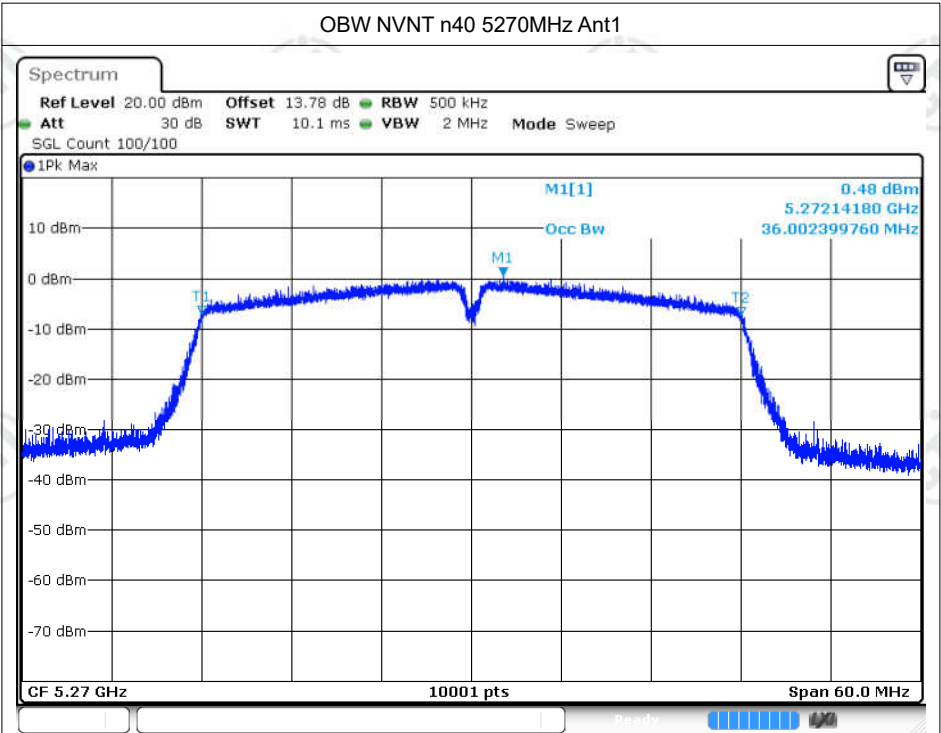


Date: 5.MAY.2024 13:18:28

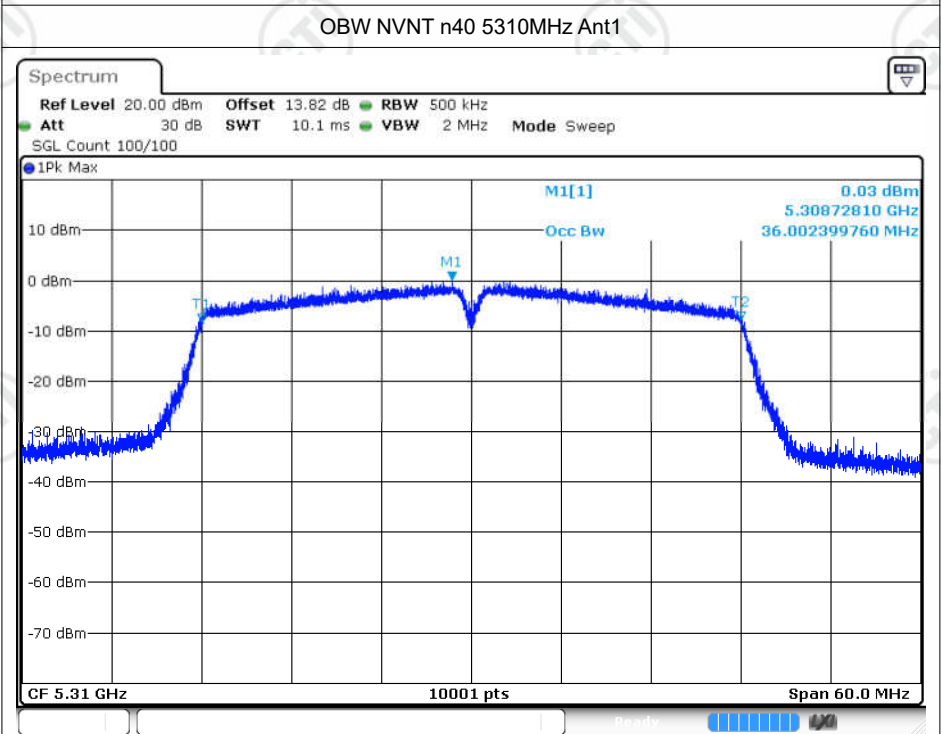


Date: 5.MAY.2024 13:20:12

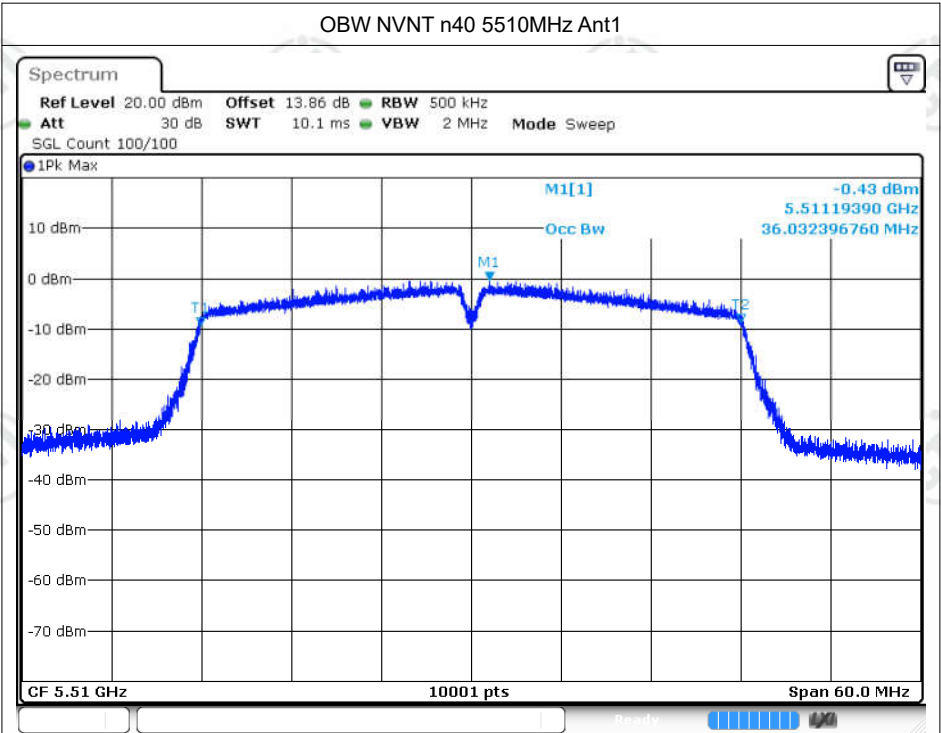


Date: 5.MAY.2024 13:22:07

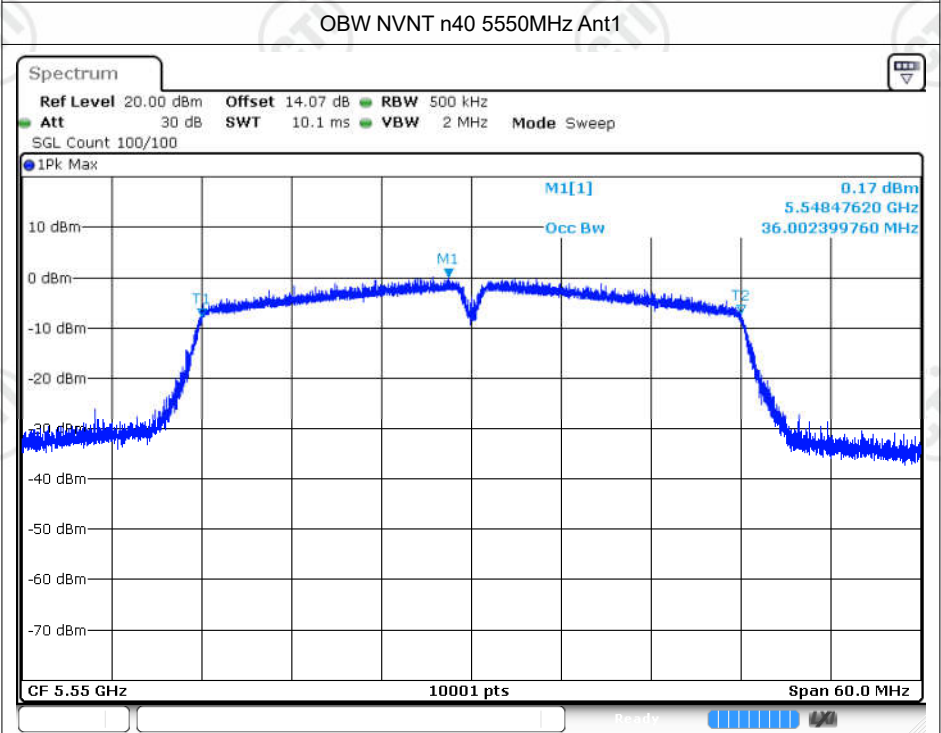



Date: 5.MAY.2024 13:27:46


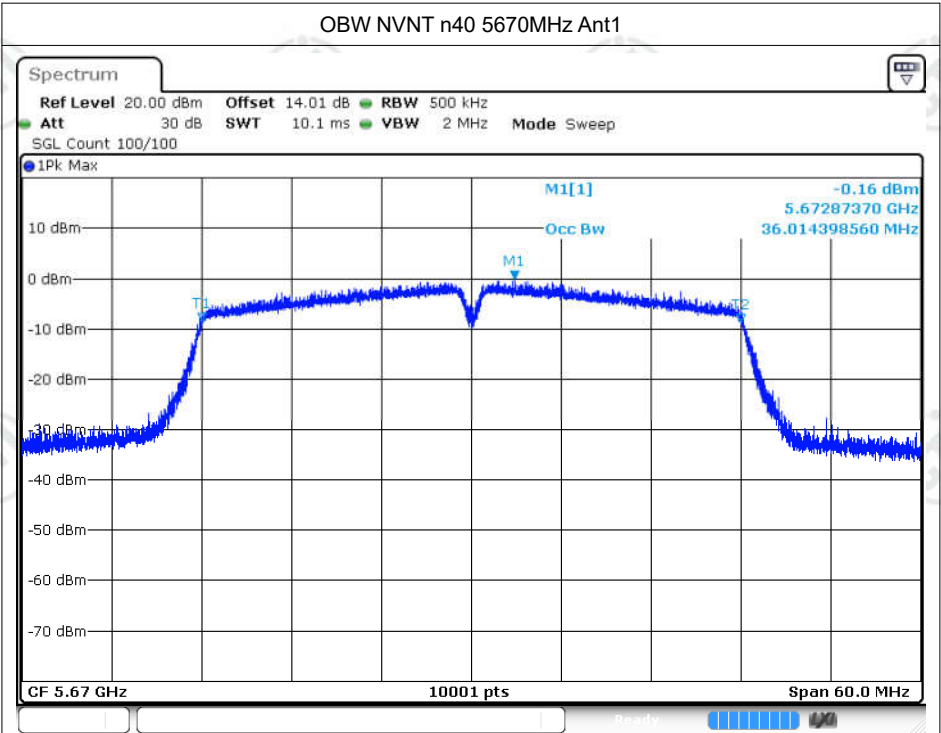



Date: 5.MAY.2024 13:29:40

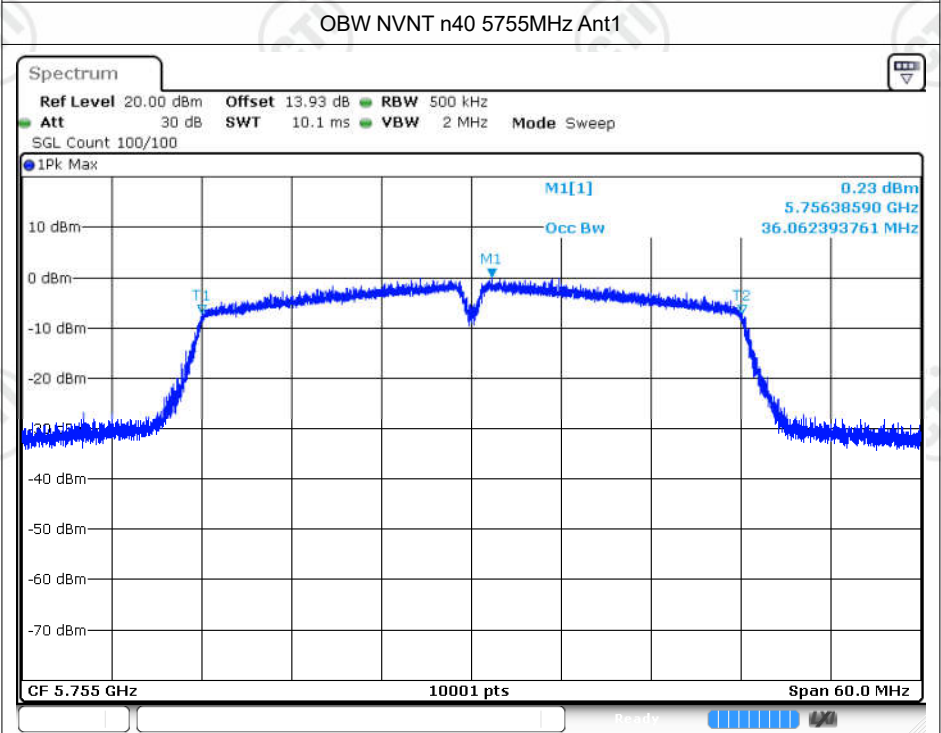


Date: 5.MAY.2024 13:14:47

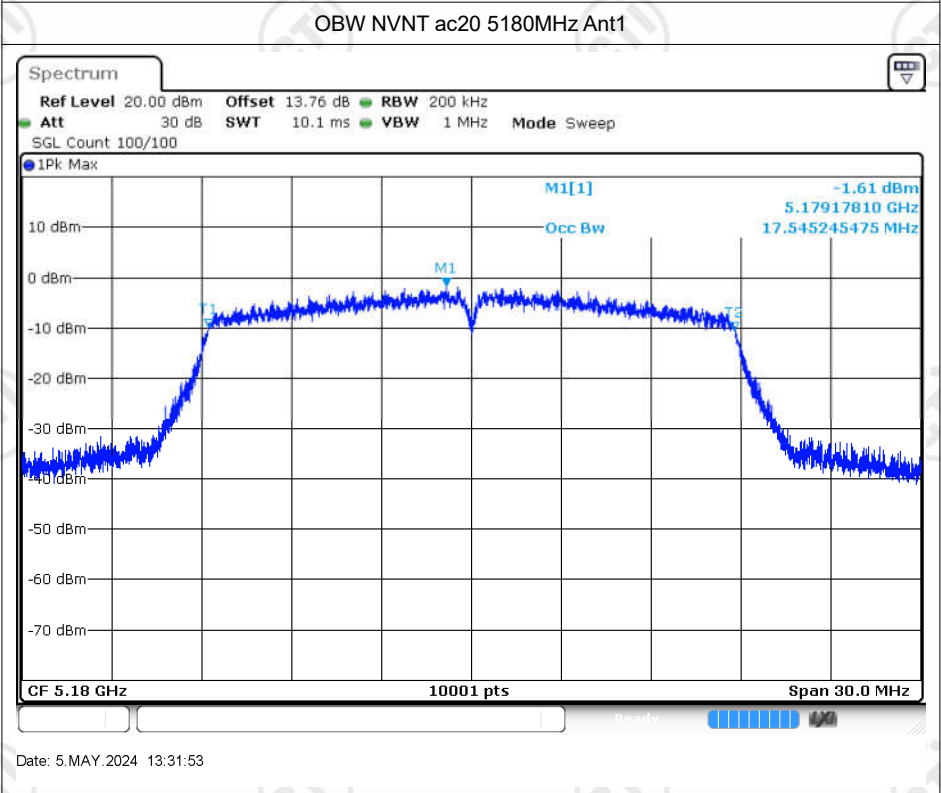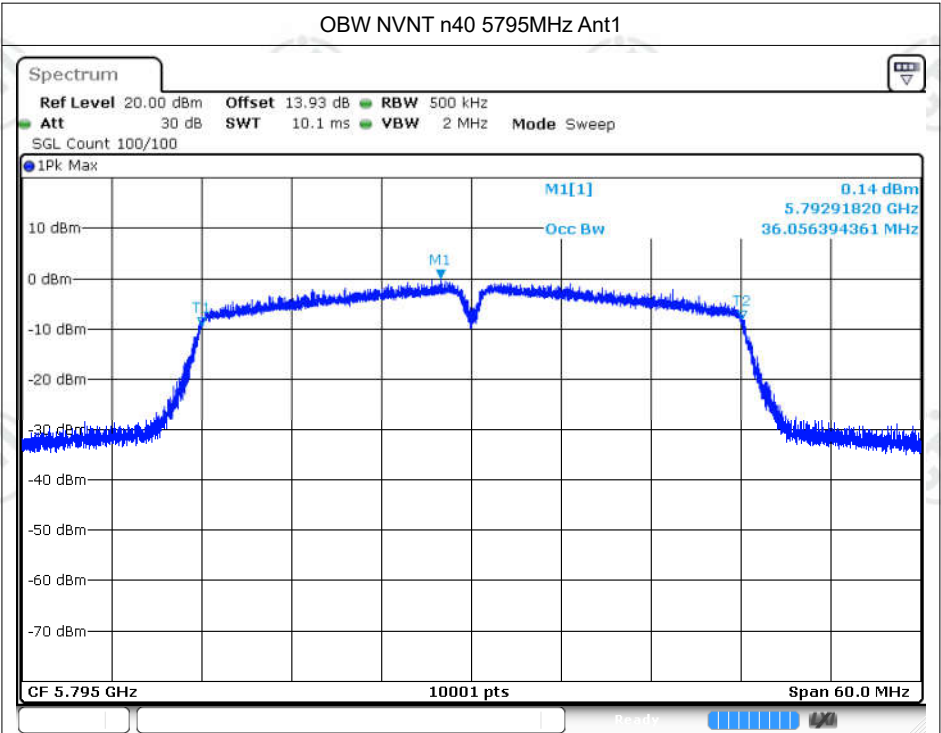

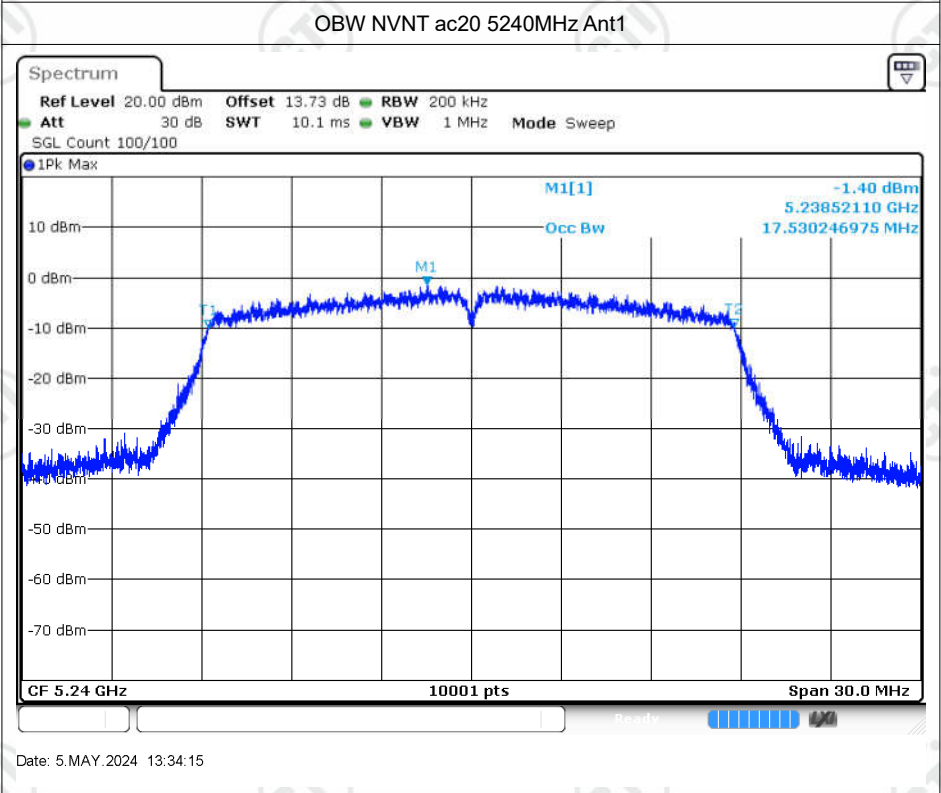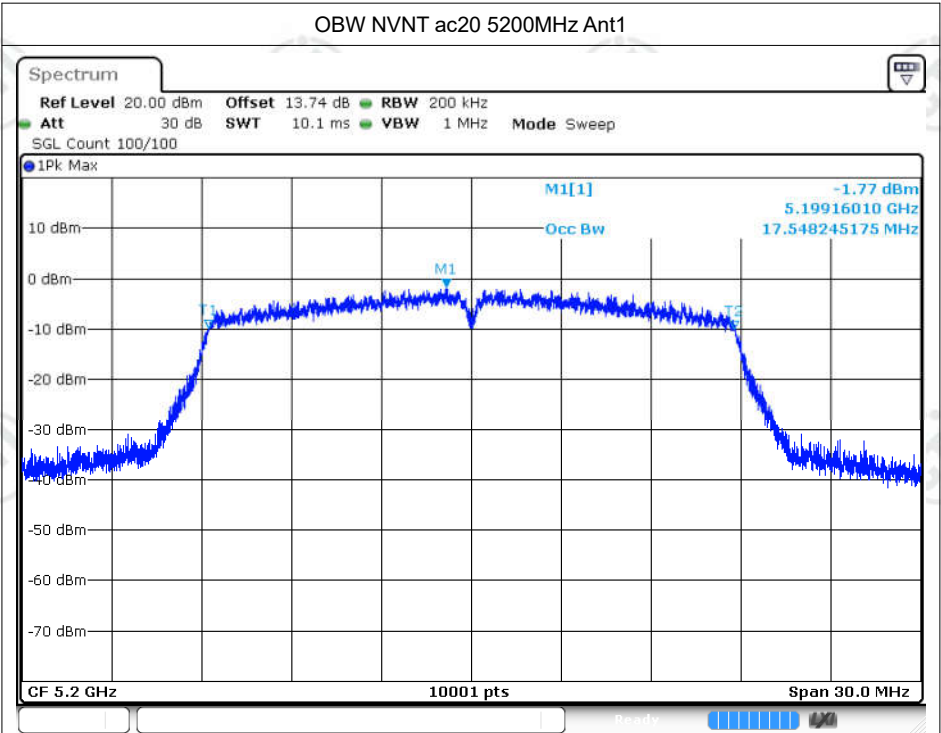


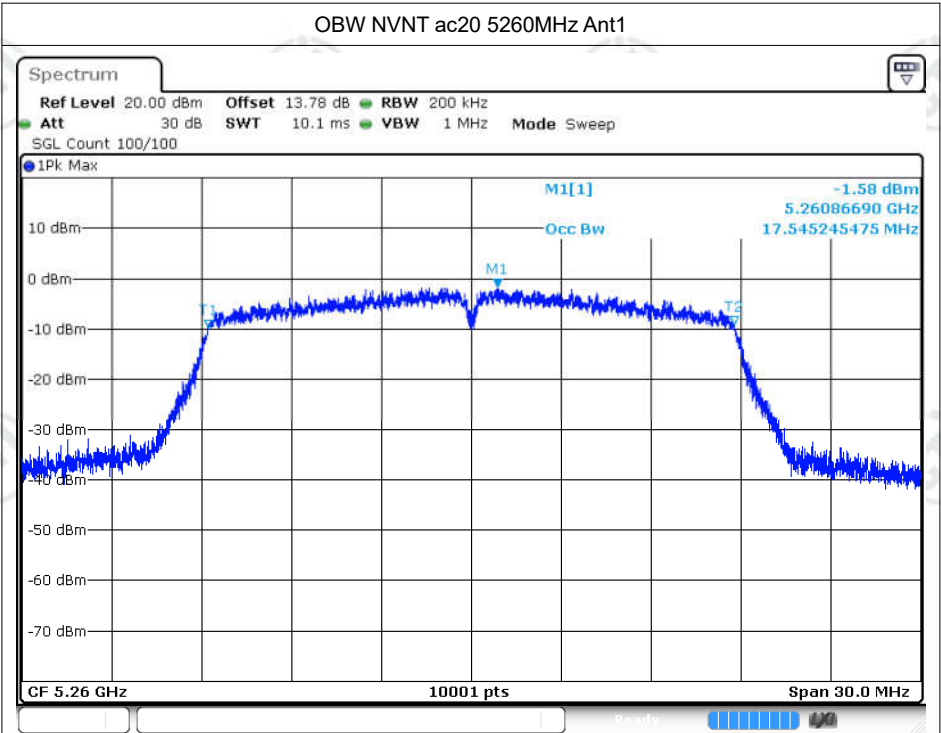


Date: 5.MAY.2024 13:39:40

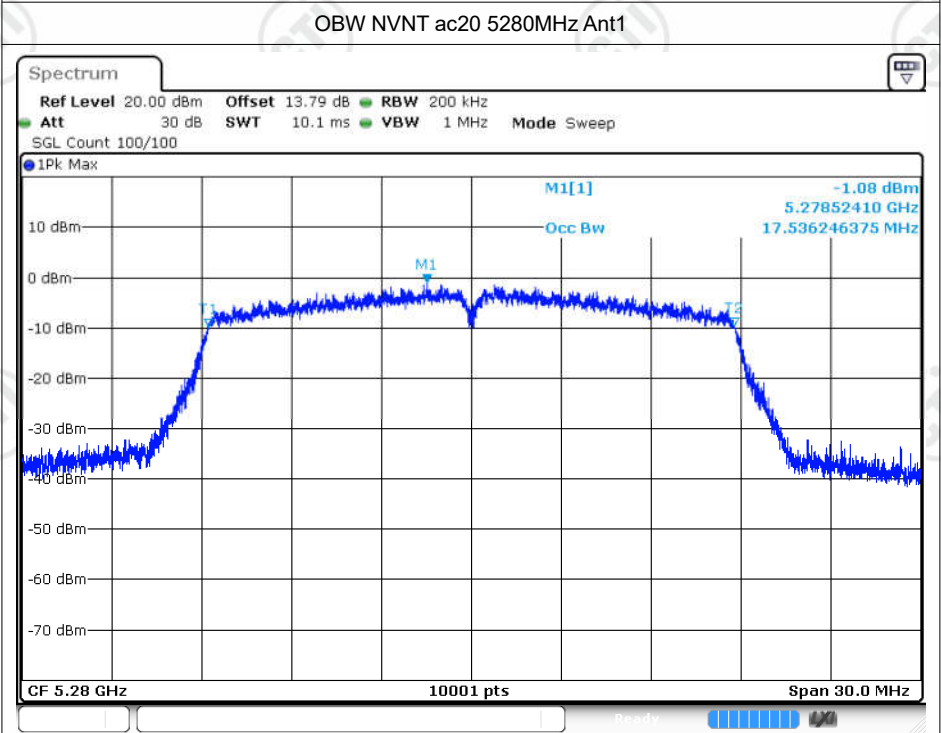


Date: 5.MAY.2024 13:42:02

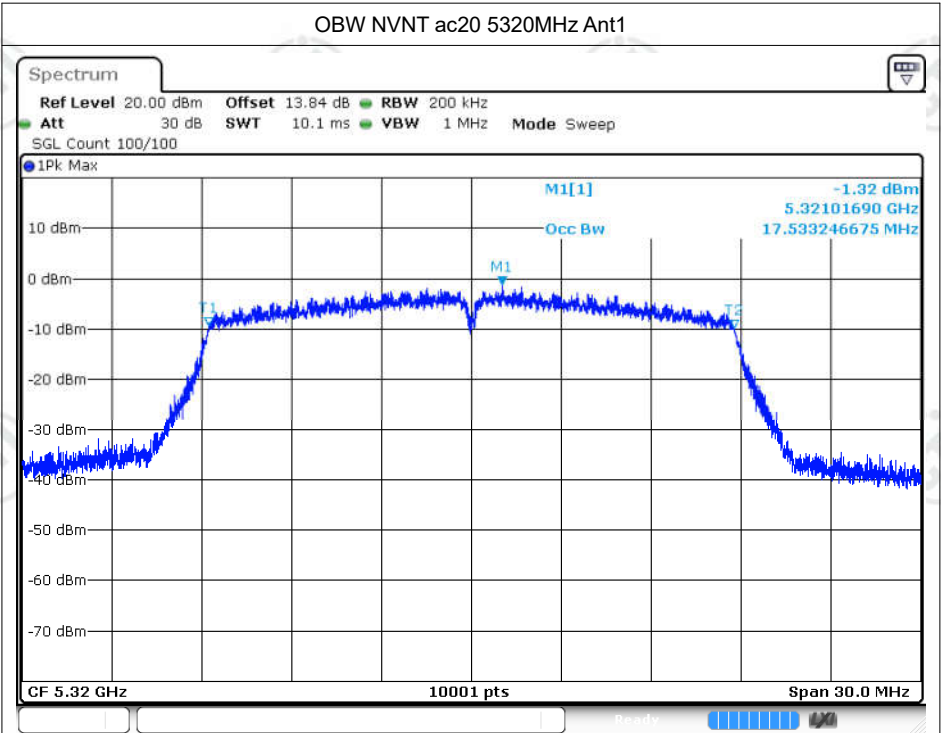


Date: 5.MAY.2024 13:43:46

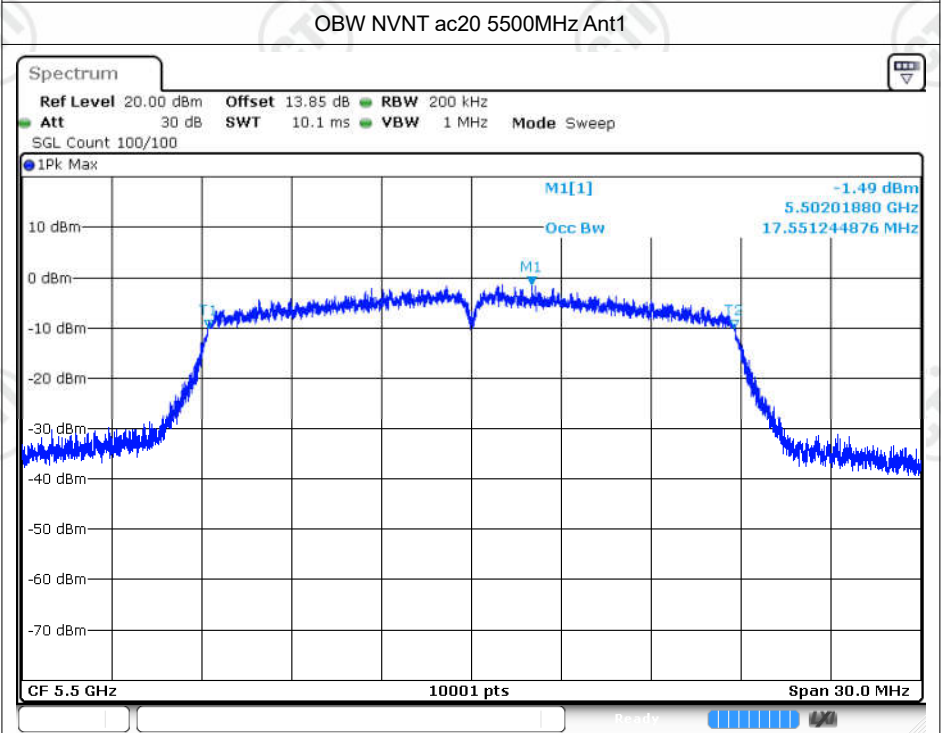



Date: 5.MAY.2024 13:45:17

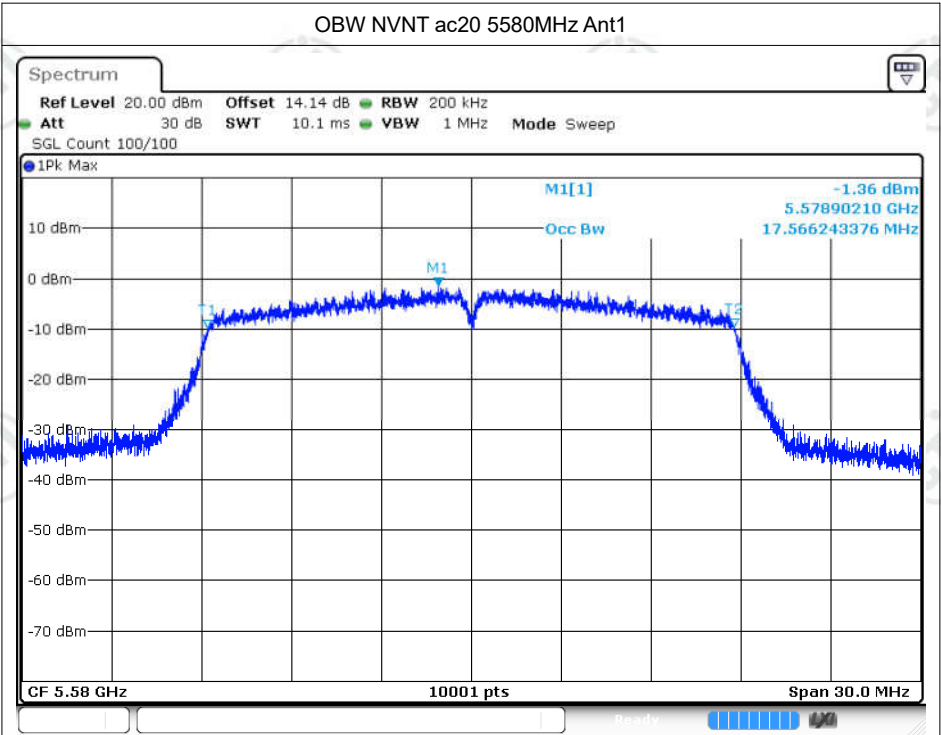


Date: 5.MAY.2024 13:48:21

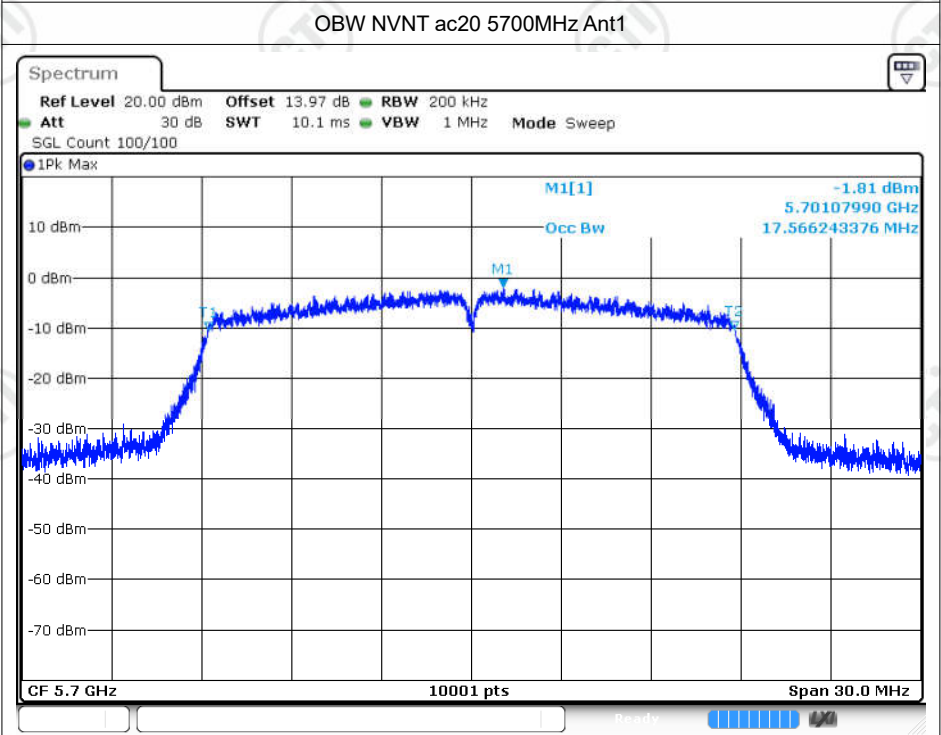


Date: 5.MAY.2024 13:46:53

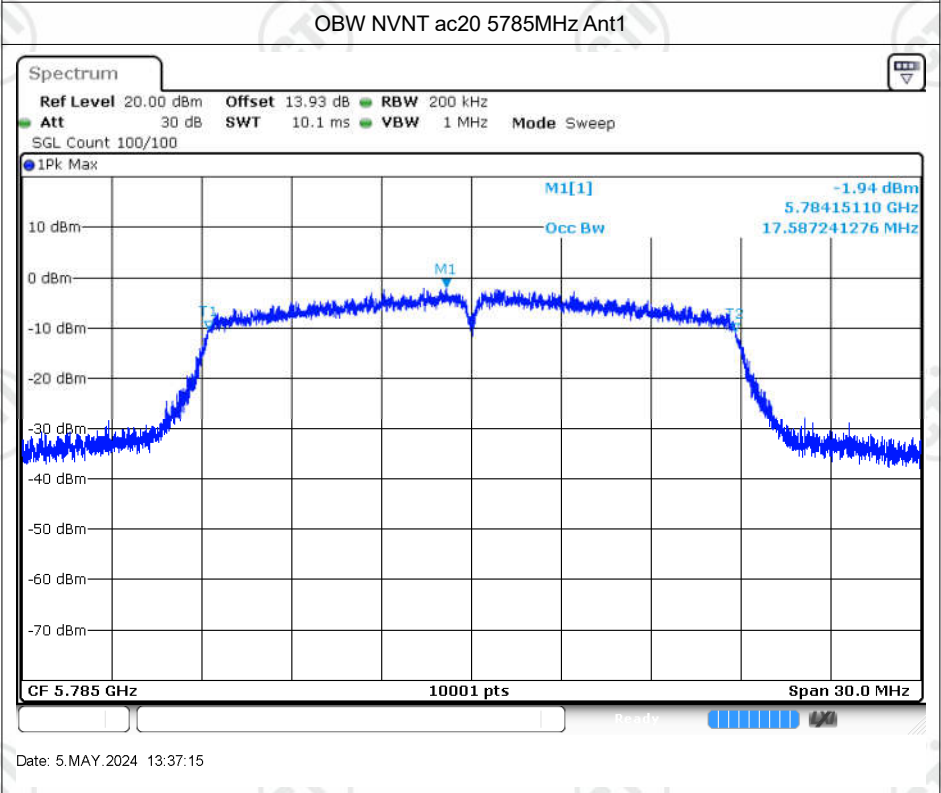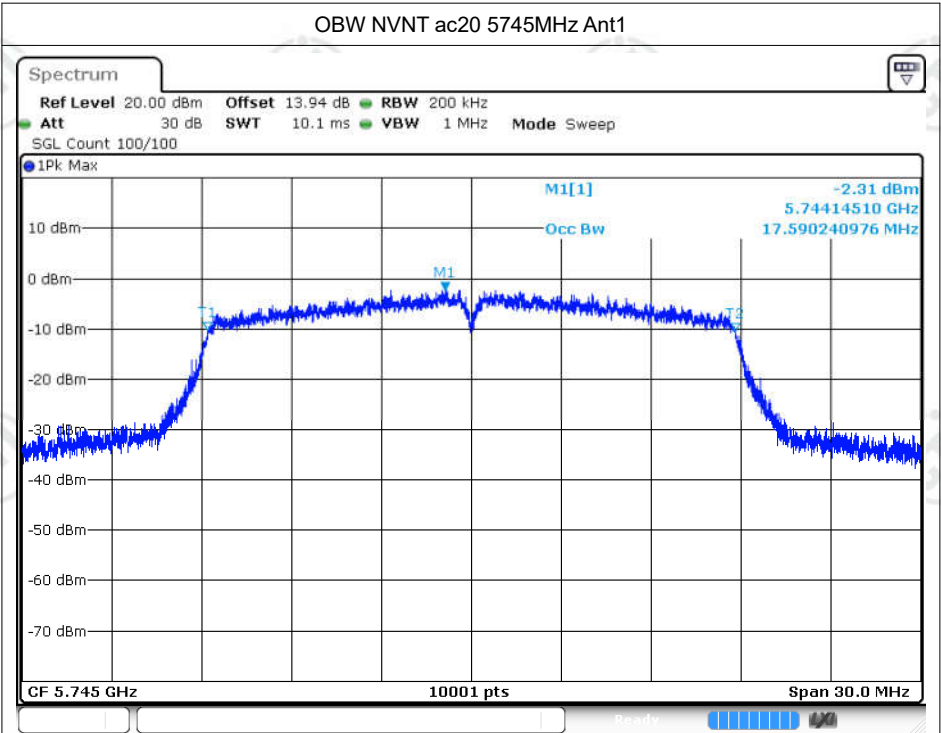


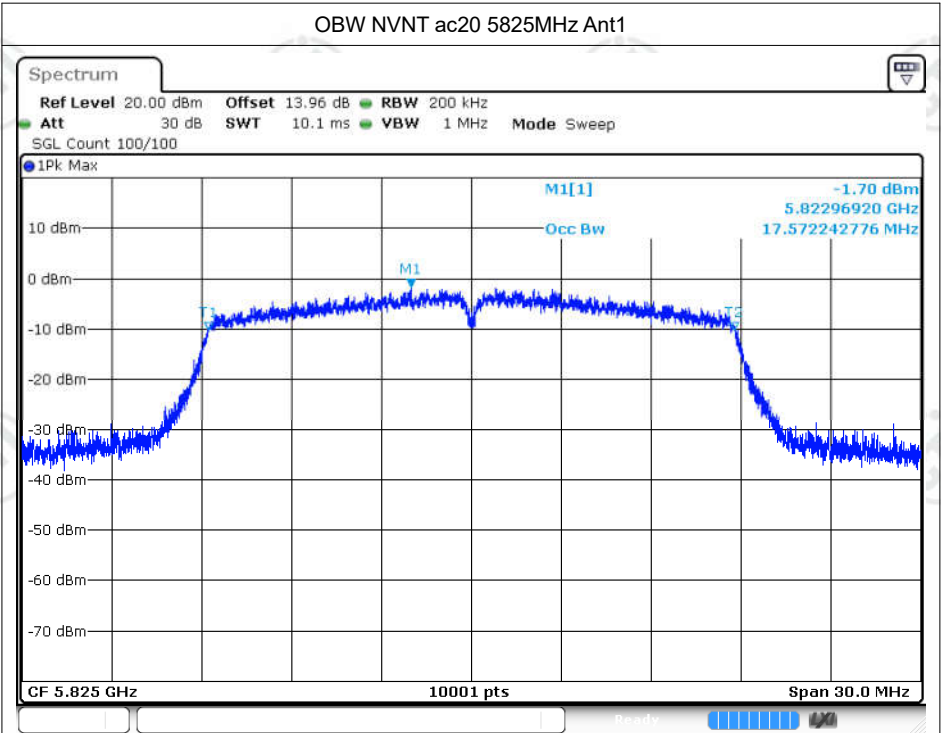


Date: 5.MAY.2024 13:38:06

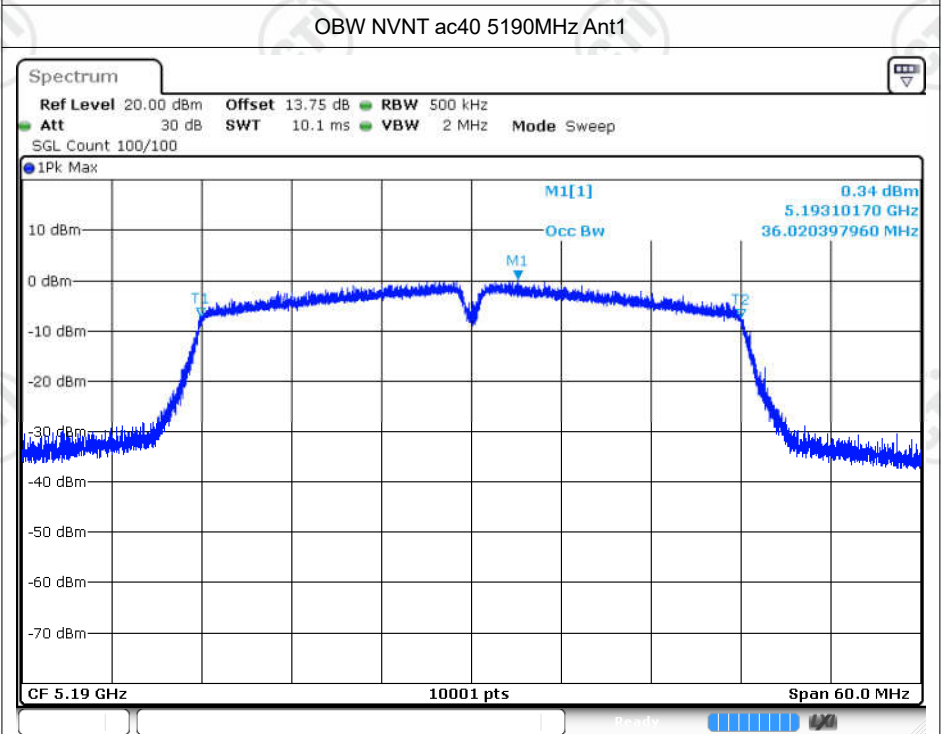



Date: 5.MAY.2024 13:50:30

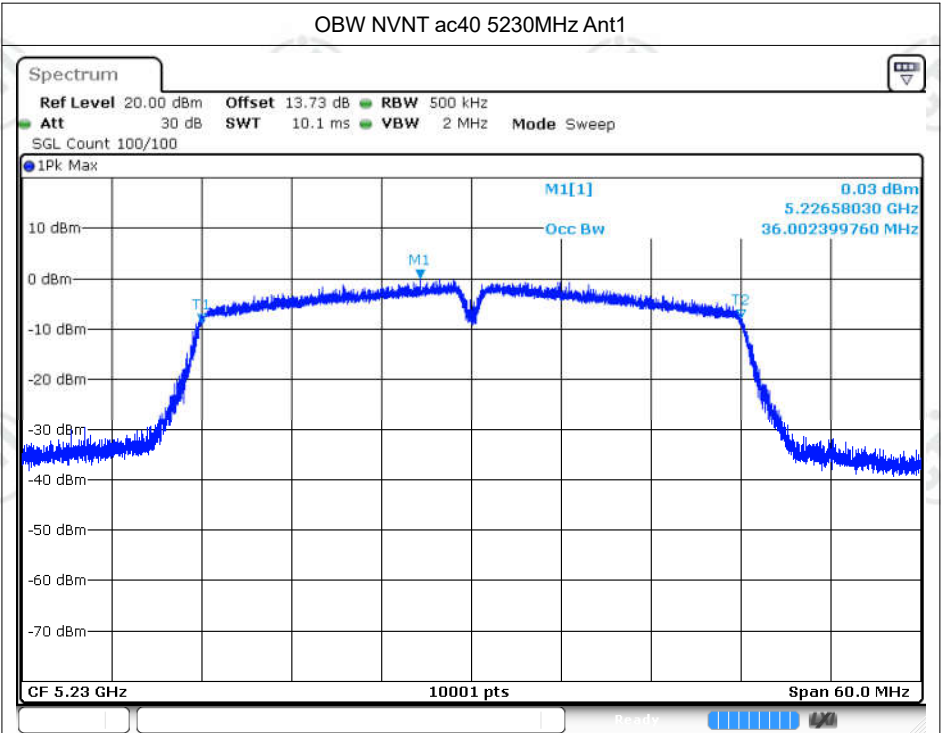


Date: 5.MAY.2024 13:52:18

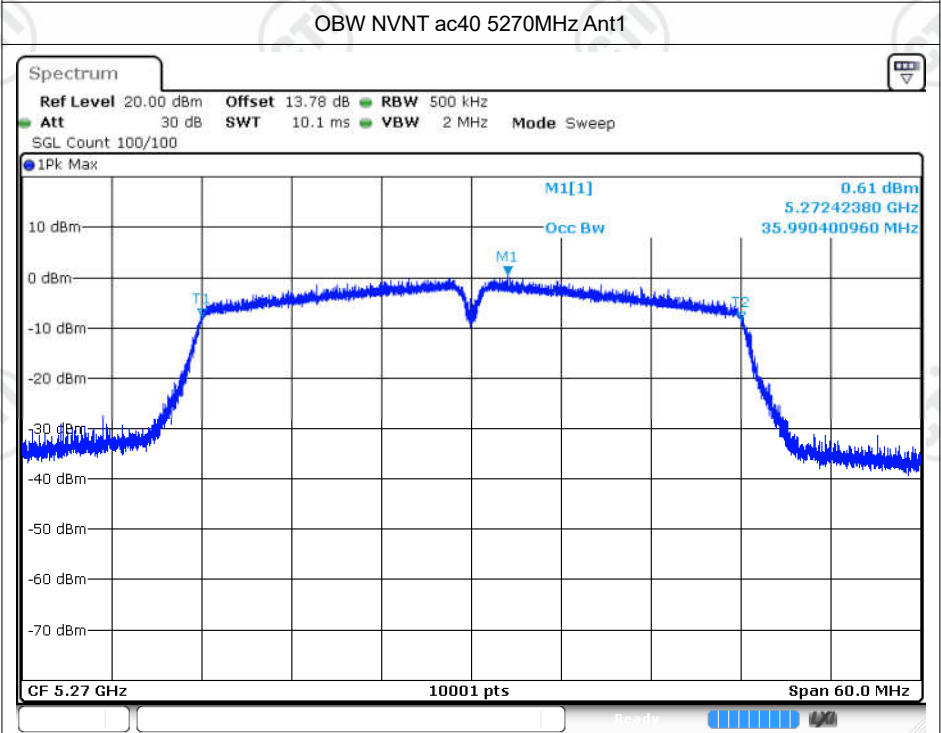


Date: 5.MAY.2024 13:58:24

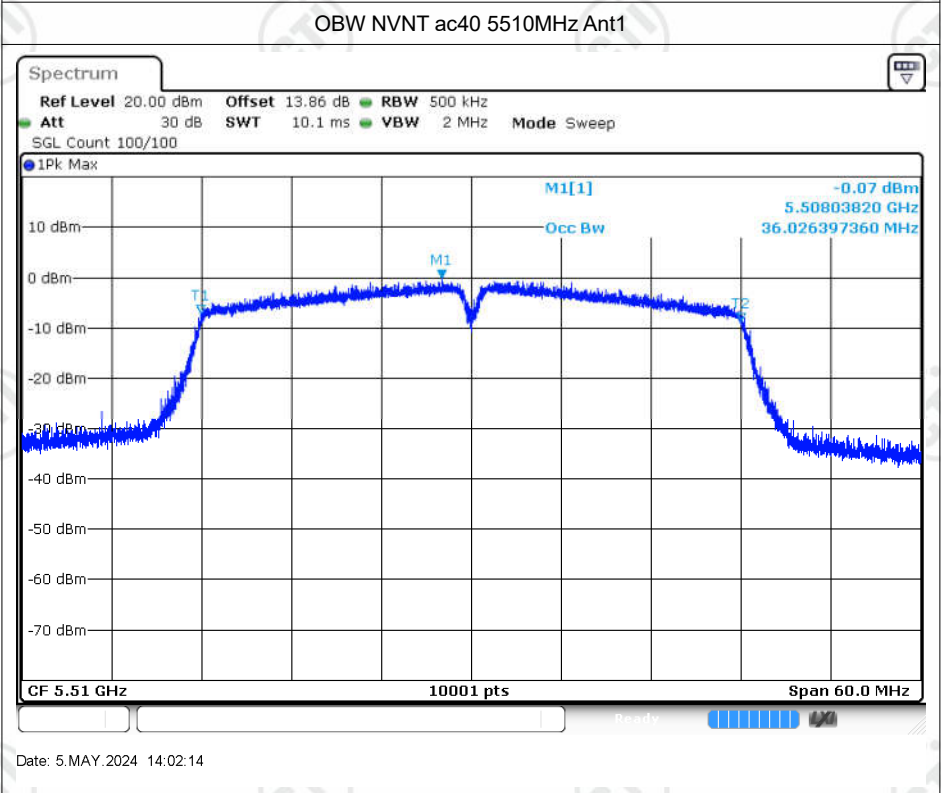
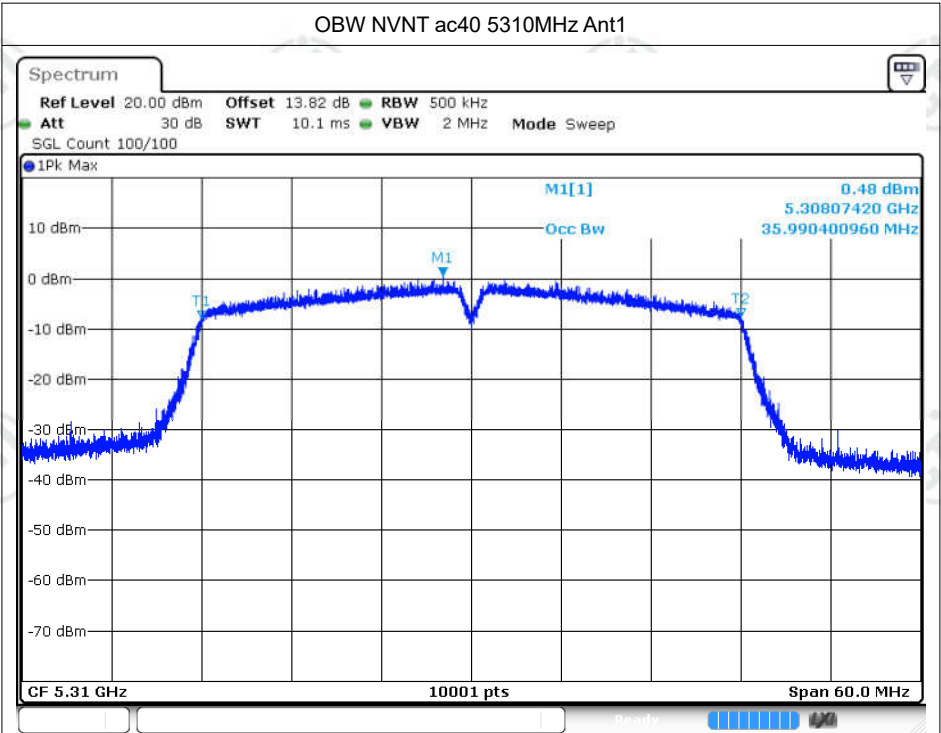


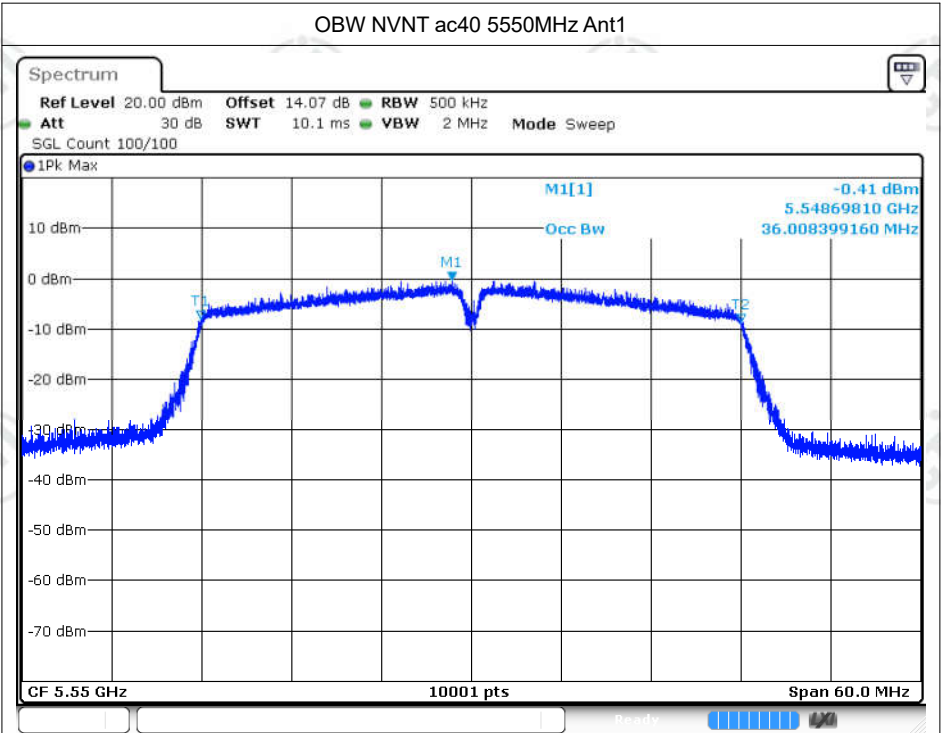


Date: 5.MAY.2024 14:04:07

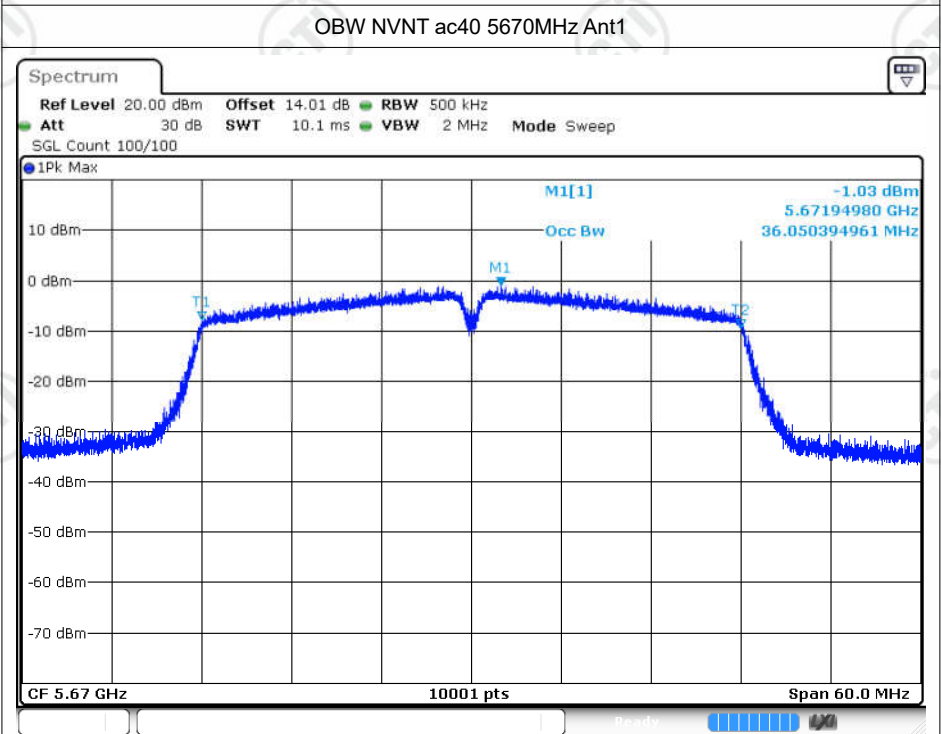


Date: 5.MAY.2024 14:05:50

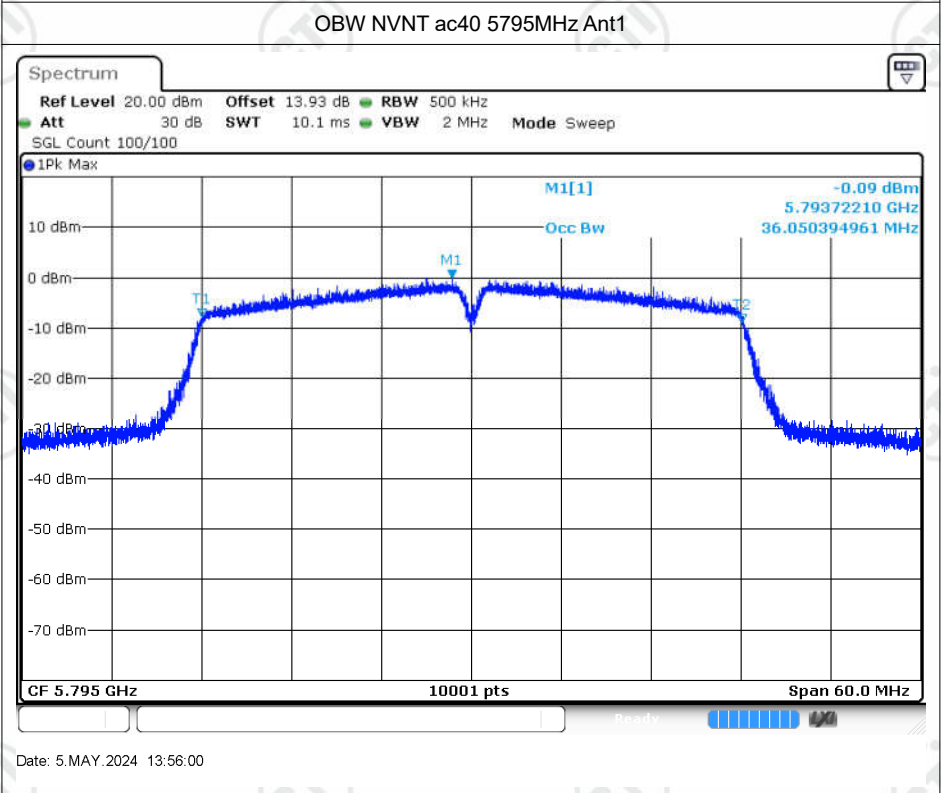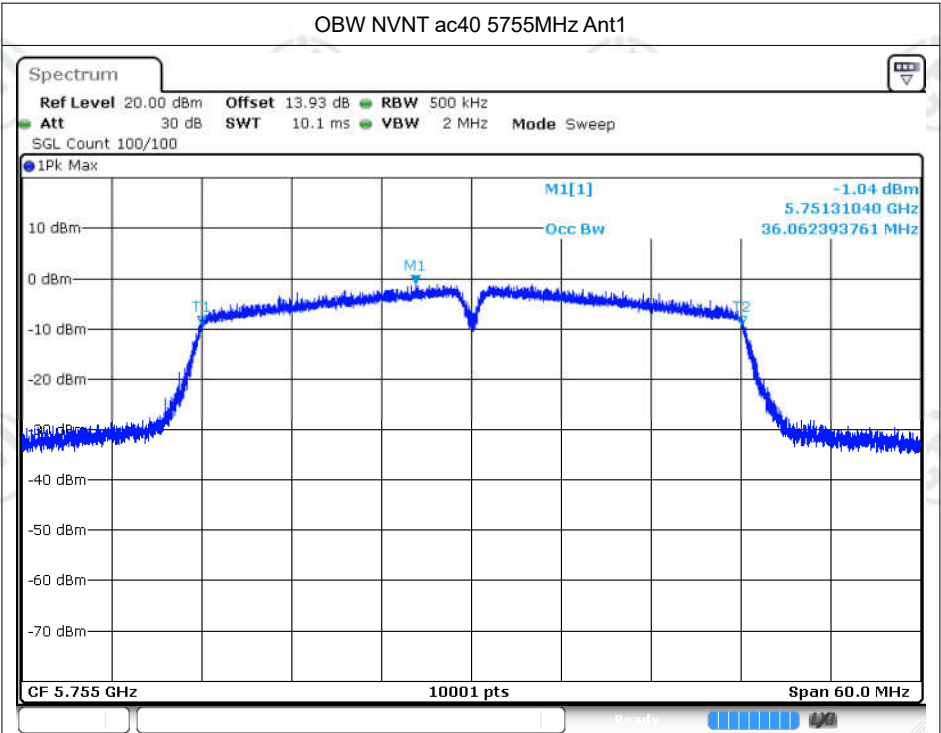


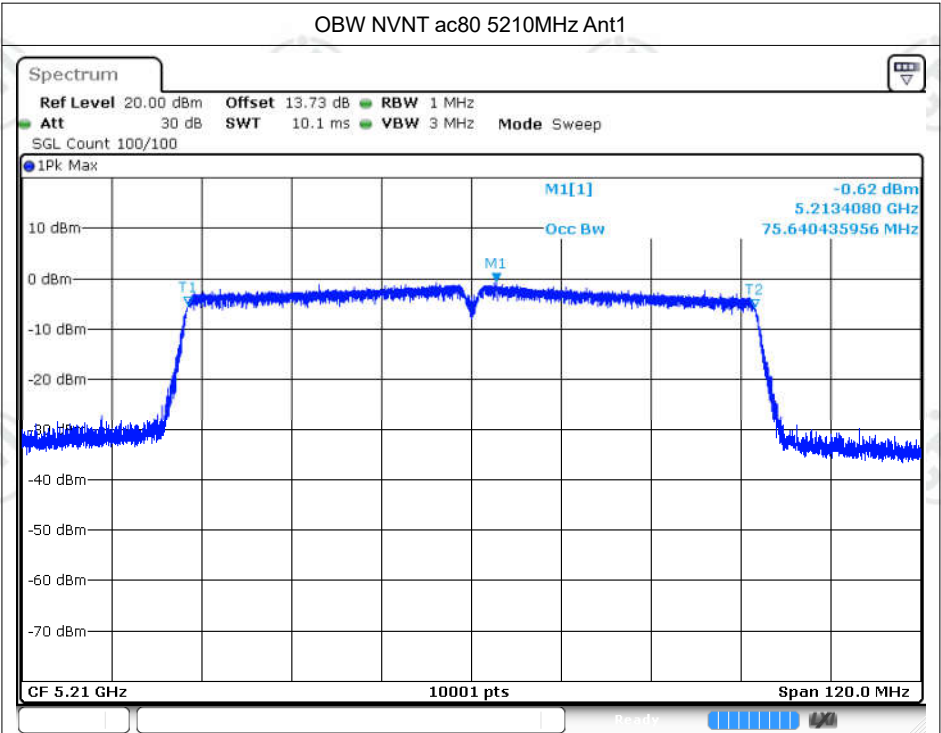


Date: 5.MAY.2024 14:09:33

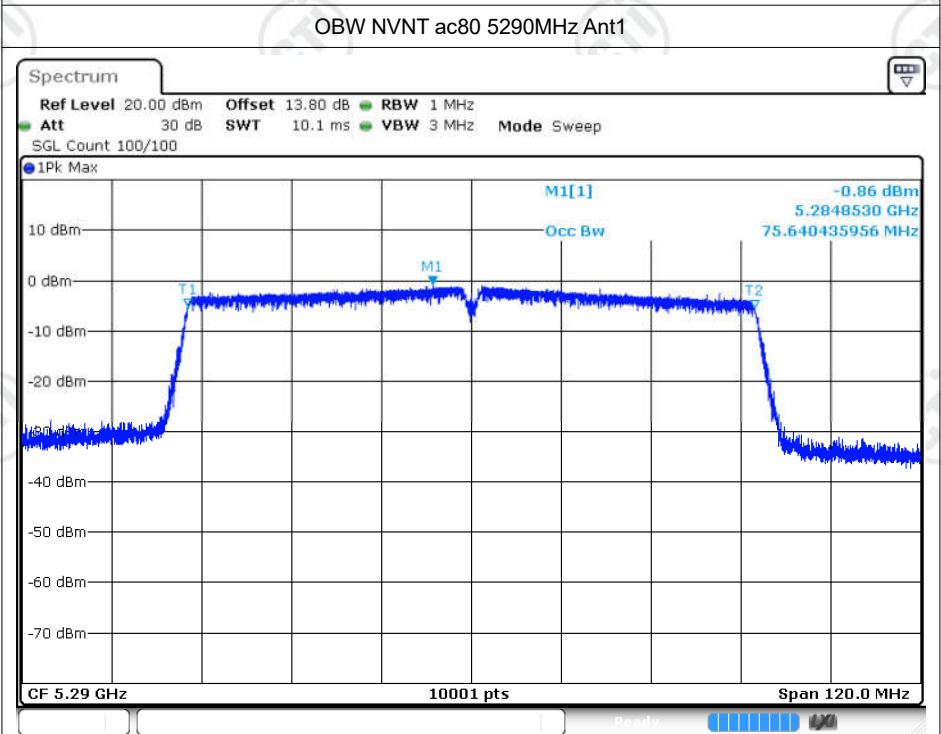

Date: 5.MAY.2024 14:14:42

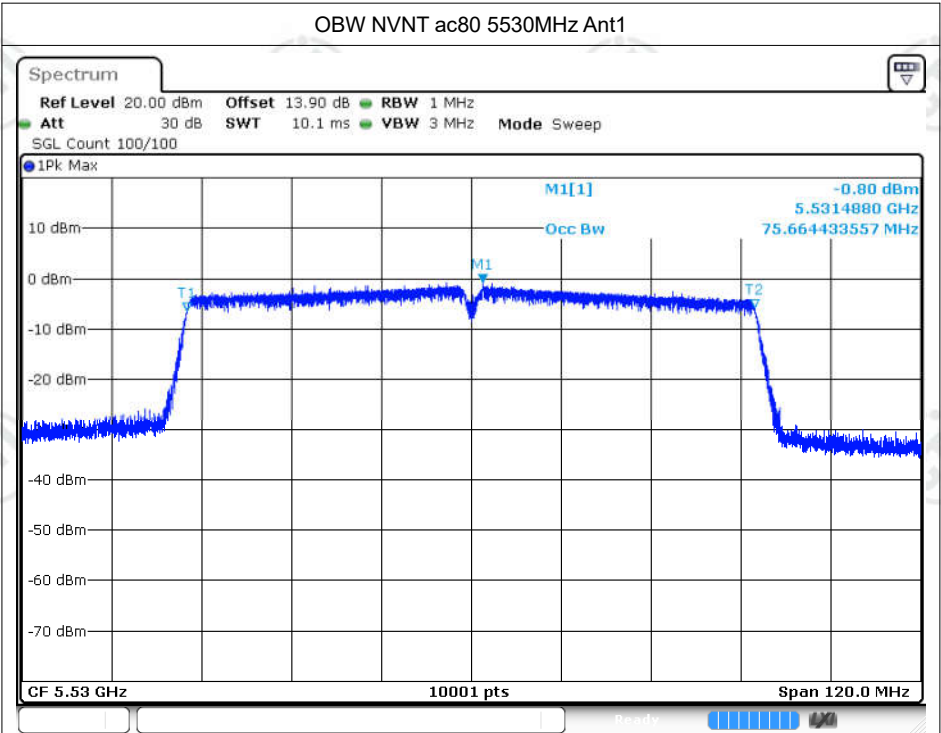

Date: 5.MAY.2024 14:17:09

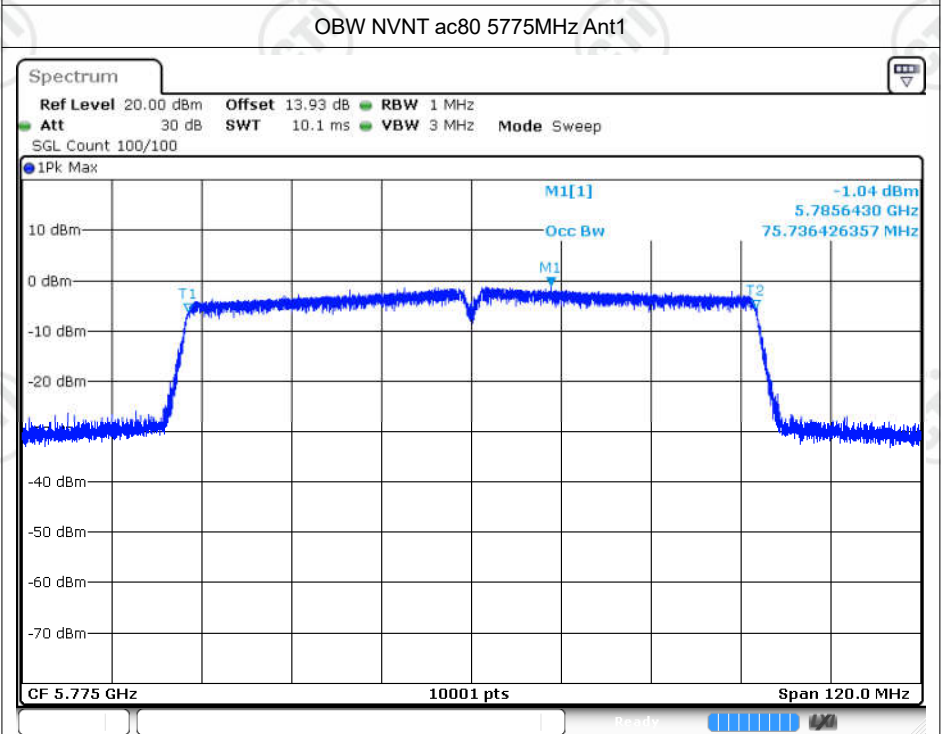


Date: 5.MAY.2024 14:12:02


Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	-2.13	10.4	Pass
NVNT	a	5200	Ant1	-2.36	10.4	Pass
NVNT	a	5240	Ant1	-2.53	10.4	Pass
NVNT	a	5260	Ant1	-2.56	10.4	Pass
NVNT	a	5280	Ant1	-2.69	10.4	Pass
NVNT	a	5320	Ant1	-5.31	10.4	Pass
NVNT	a	5500	Ant1	-2.91	10.4	Pass
NVNT	a	5580	Ant1	-3.28	10.4	Pass
NVNT	a	5700	Ant1	-3.59	10.4	Pass
NVNT	a	5745	Ant1	-6.38	29.4	Pass
NVNT	a	5785	Ant1	-5.98	29.4	Pass
NVNT	a	5825	Ant1	-6.19	29.4	Pass
NVNT	n20	5180	Ant1	-3.43	10.4	Pass
NVNT	n20	5200	Ant1	-3.1	10.4	Pass
NVNT	n20	5240	Ant1	-3.14	10.4	Pass
NVNT	n20	5260	Ant1	-2.92	10.4	Pass
NVNT	n20	5280	Ant1	-3.02	10.4	Pass
NVNT	n20	5320	Ant1	-3.28	10.4	Pass
NVNT	n20	5500	Ant1	-3.24	10.4	Pass
NVNT	n20	5580	Ant1	-3.34	10.4	Pass
NVNT	n20	5700	Ant1	-3.5	10.4	Pass
NVNT	n20	5745	Ant1	-6.41	29.4	Pass
NVNT	n20	5785	Ant1	-6.24	29.4	Pass
NVNT	n20	5825	Ant1	-6.05	29.4	Pass
NVNT	n40	5190	Ant1	-5.49	10.4	Pass
NVNT	n40	5230	Ant1	-5.88	10.4	Pass
NVNT	n40	5270	Ant1	-5.38	10.4	Pass
NVNT	n40	5310	Ant1	-5.88	10.4	Pass
NVNT	n40	5510	Ant1	-6.09	10.4	Pass
NVNT	n40	5550	Ant1	-5.58	10.4	Pass
NVNT	n40	5670	Ant1	-5.96	10.4	Pass
NVNT	n40	5755	Ant1	-8.7	29.4	Pass
NVNT	n40	5795	Ant1	-8.88	29.4	Pass
NVNT	ac20	5180	Ant1	-3.5	10.4	Pass
NVNT	ac20	5200	Ant1	-3.24	10.4	Pass
NVNT	ac20	5240	Ant1	-3.04	10.4	Pass
NVNT	ac20	5260	Ant1	-3.02	10.4	Pass
NVNT	ac20	5280	Ant1	-2.86	10.4	Pass


NVNT	ac20	5320	Ant1	-3.1	10.4	Pass
NVNT	ac20	5500	Ant1	-3.08	10.4	Pass
NVNT	ac20	5580	Ant1	-3.13	10.4	Pass
NVNT	ac20	5700	Ant1	-3.36	10.4	Pass
NVNT	ac20	5745	Ant1	-6.57	29.4	Pass
NVNT	ac20	5785	Ant1	-6.48	29.4	Pass
NVNT	ac20	5825	Ant1	-6.05	29.4	Pass
NVNT	ac40	5190	Ant1	-5.68	10.4	Pass
NVNT	ac40	5230	Ant1	-5.96	10.4	Pass
NVNT	ac40	5270	Ant1	-5.64	10.4	Pass
NVNT	ac40	5310	Ant1	-6	10.4	Pass
NVNT	ac40	5510	Ant1	-5.87	10.4	Pass
NVNT	ac40	5550	Ant1	-6.07	10.4	Pass
NVNT	ac40	5670	Ant1	-6.85	10.4	Pass
NVNT	ac40	5755	Ant1	-9.47	29.4	Pass
NVNT	ac40	5795	Ant1	-8.93	29.4	Pass
NVNT	ac80	5210	Ant1	-10.06	10.4	Pass
NVNT	ac80	5290	Ant1	-10.29	10.4	Pass
NVNT	ac80	5530	Ant1	-10.58	10.4	Pass
NVNT	ac80	5775	Ant1	-13.38	29.4	Pass

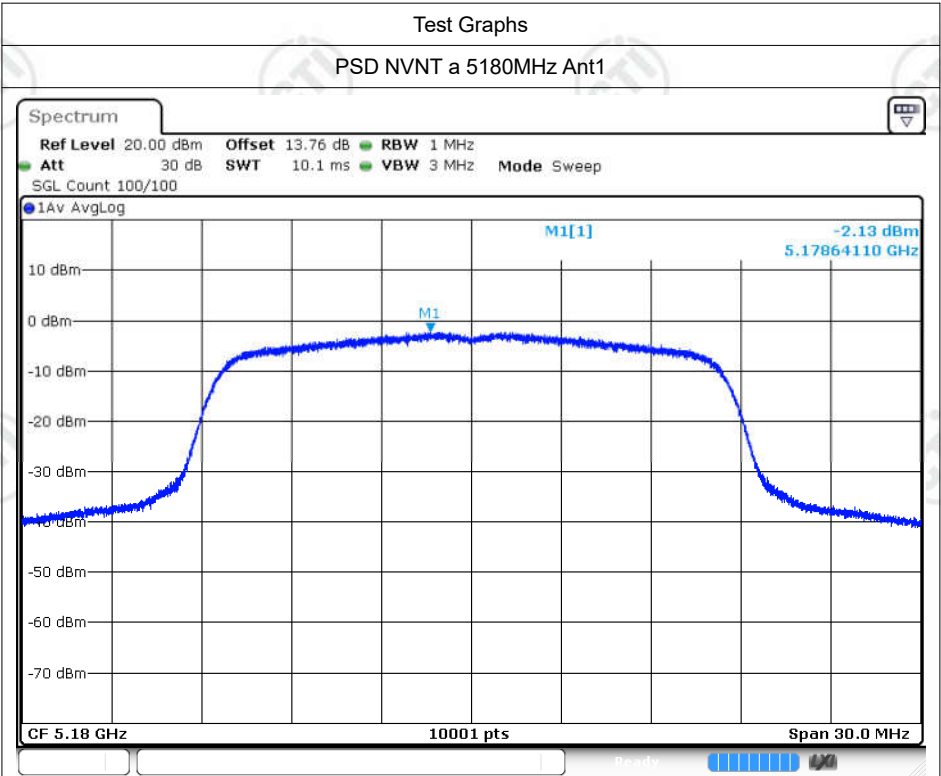


Date: 5.MAY.2024 12:27:09

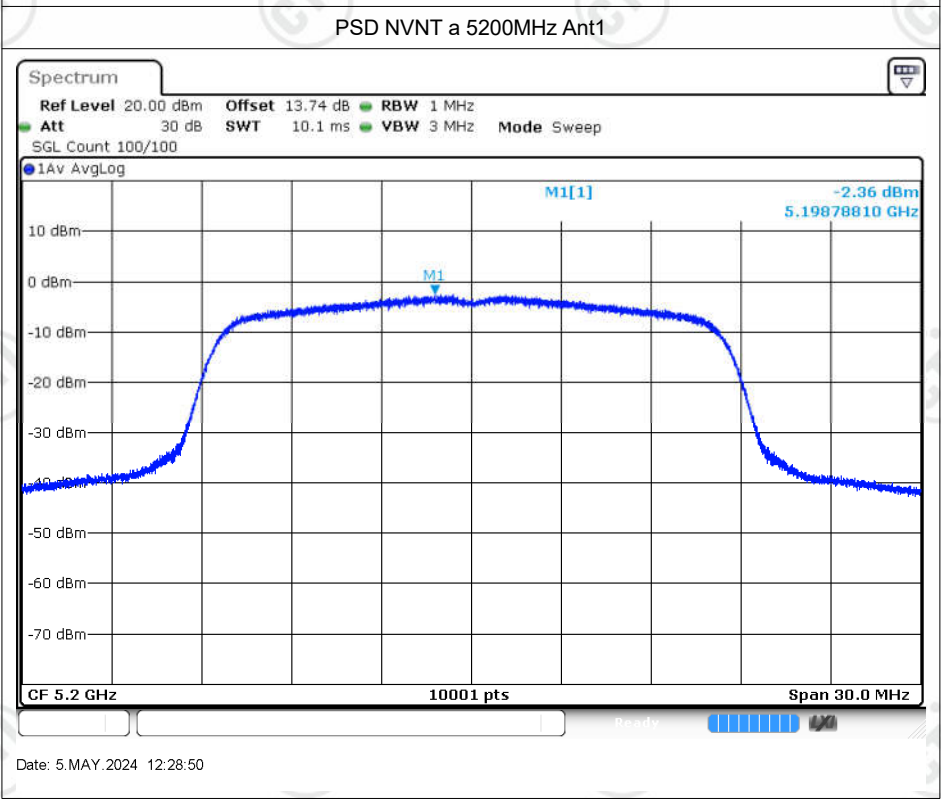


Date: 5.MAY.2024 12:28:50

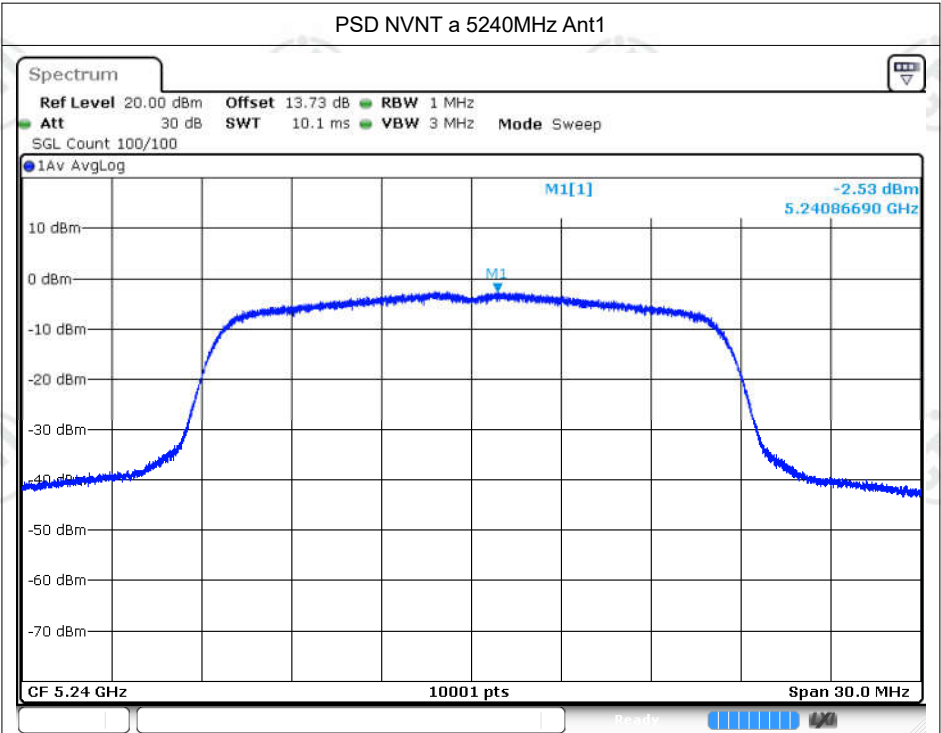


Date: 5.MAY.2024 12:29:59

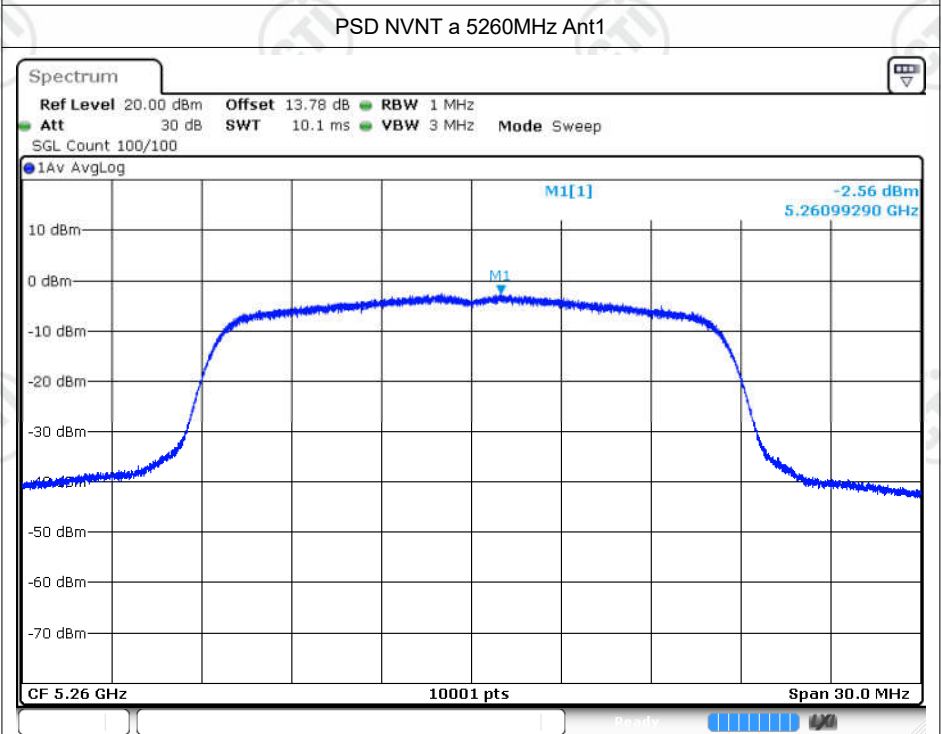


Date: 5.MAY.2024 12:37:06

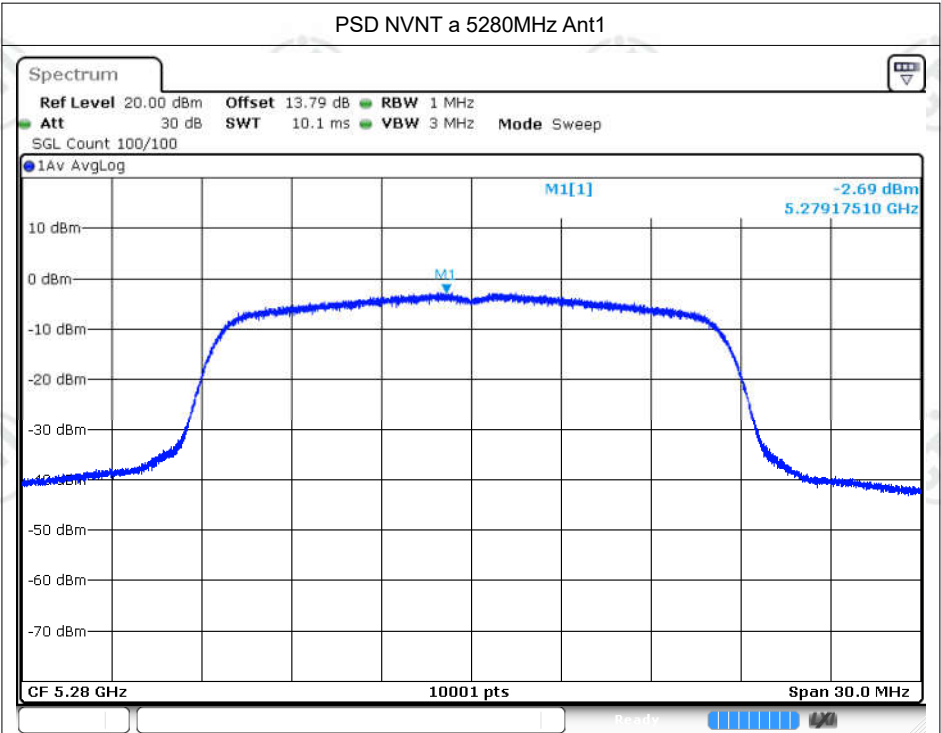


Date: 5.MAY.2024 12:39:43

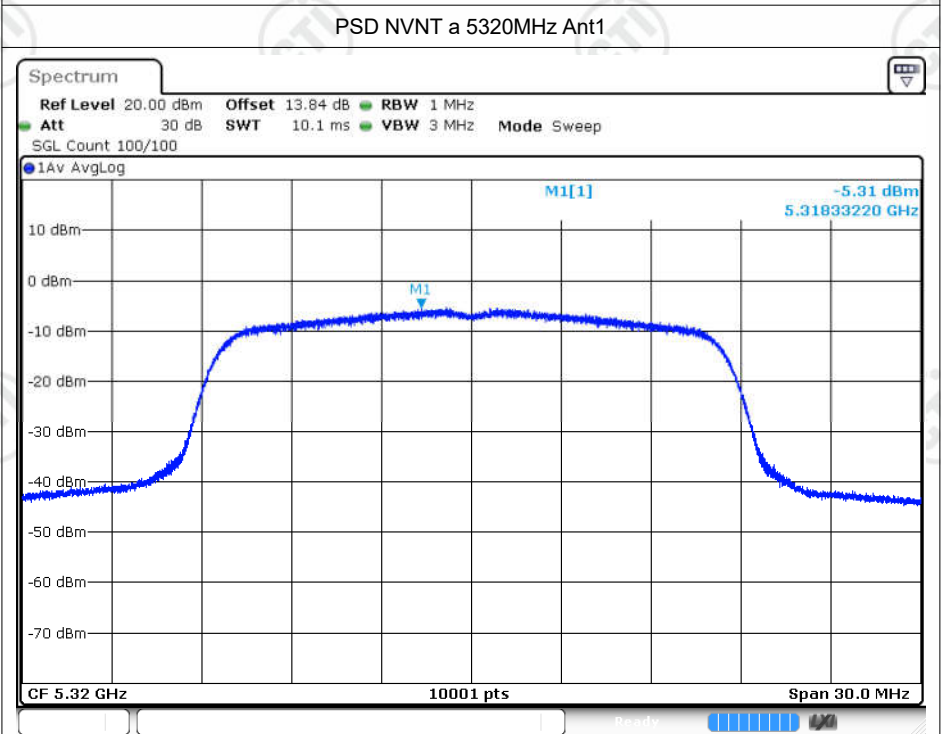


Date: 5.MAY.2024 12:41:24




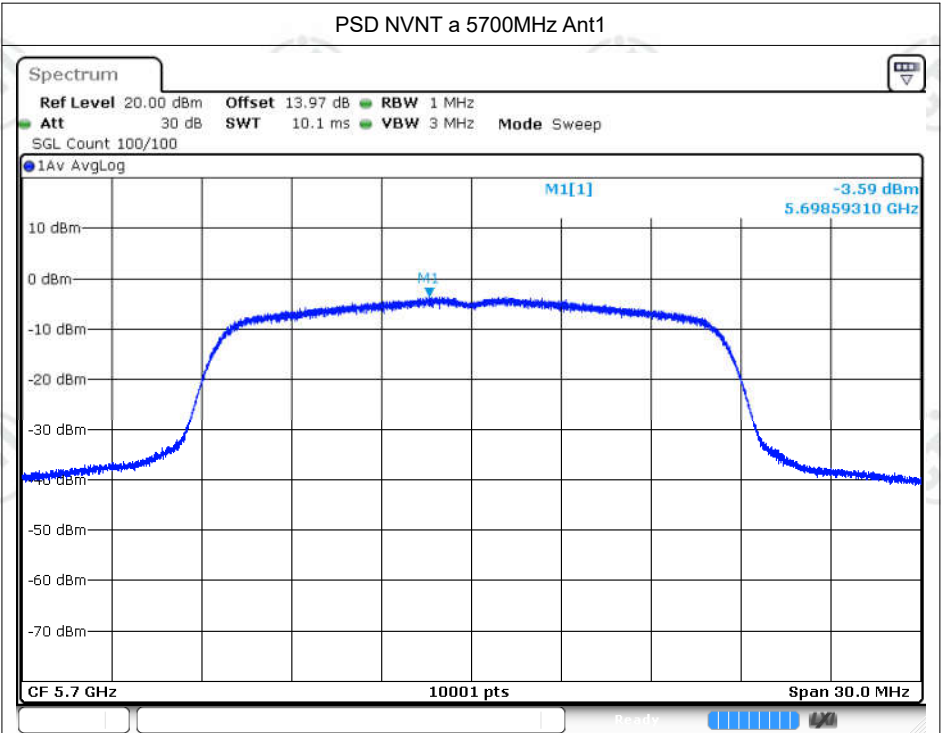


Date: 5.MAY.2024 12:45:54

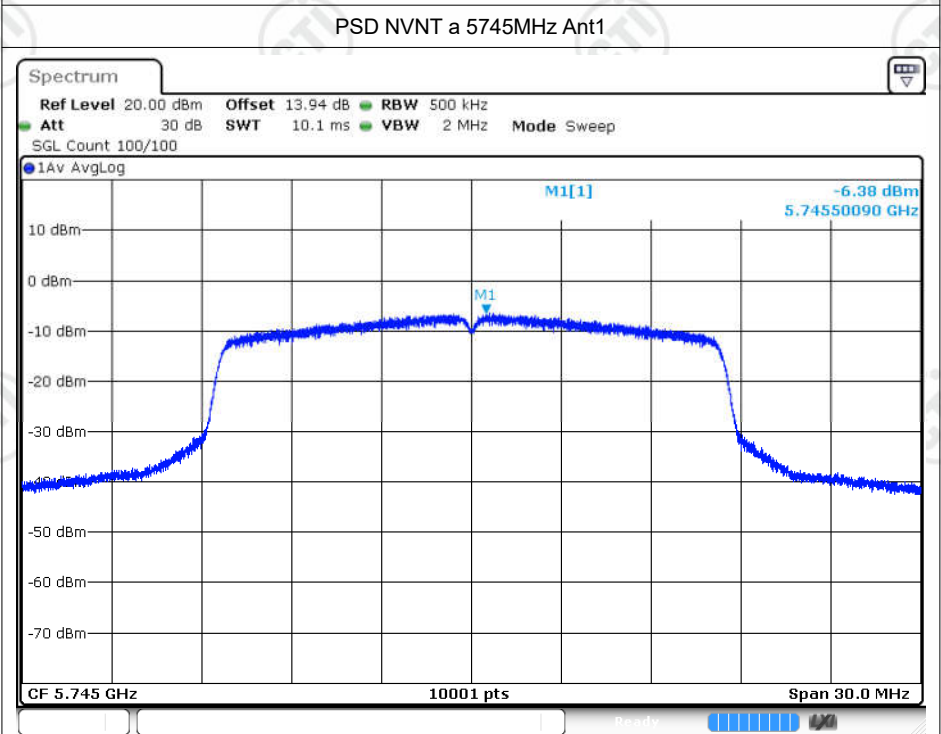


Date: 5.MAY.2024 12:32:07

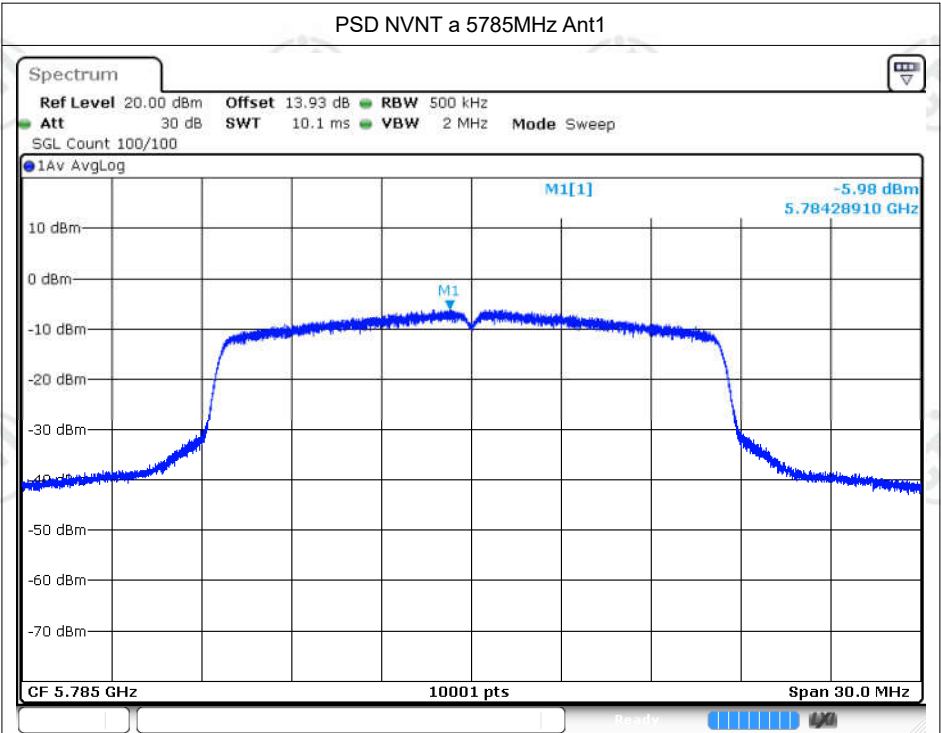


Date: 5.MAY.2024 12:33:52

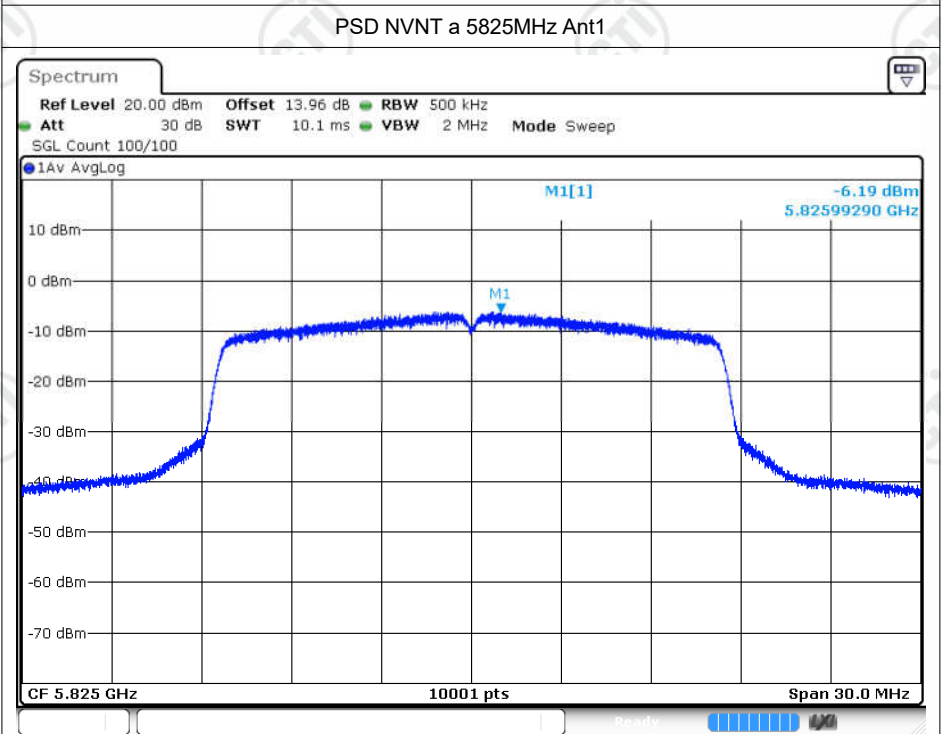


Date: 5.MAY.2024 12:34:46

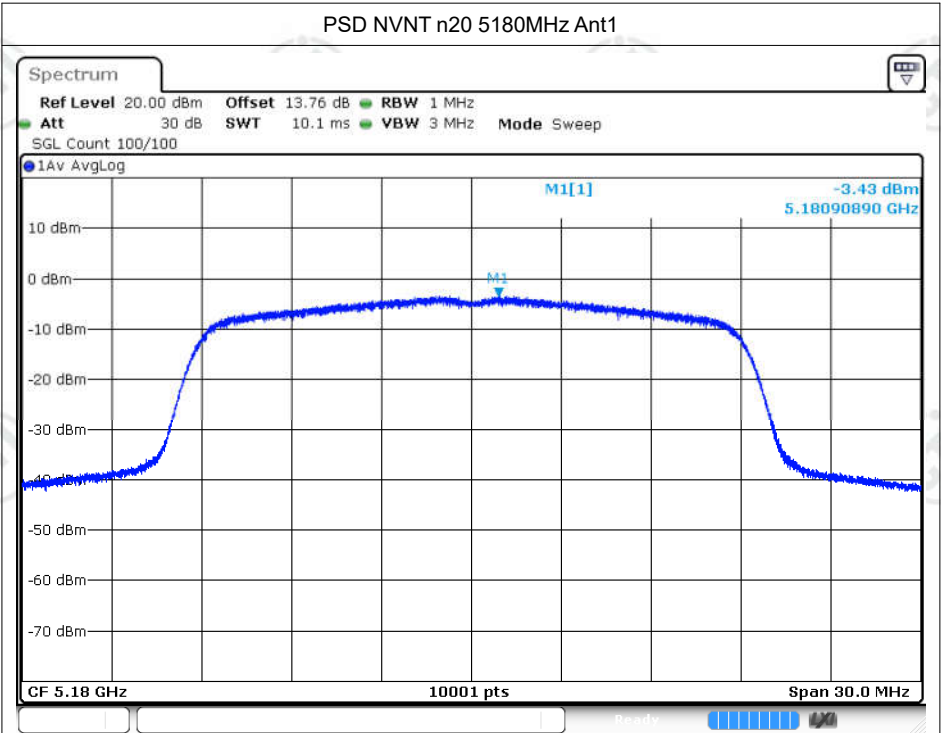


Date: 5.MAY.2024 12:49:19

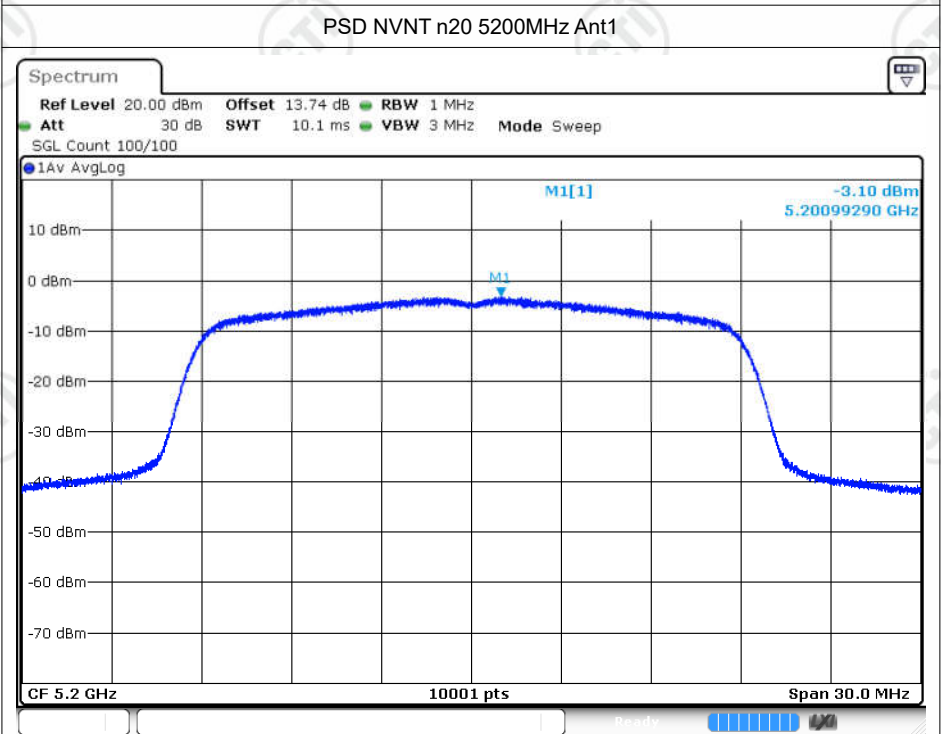


Date: 5.MAY.2024 12:53:06

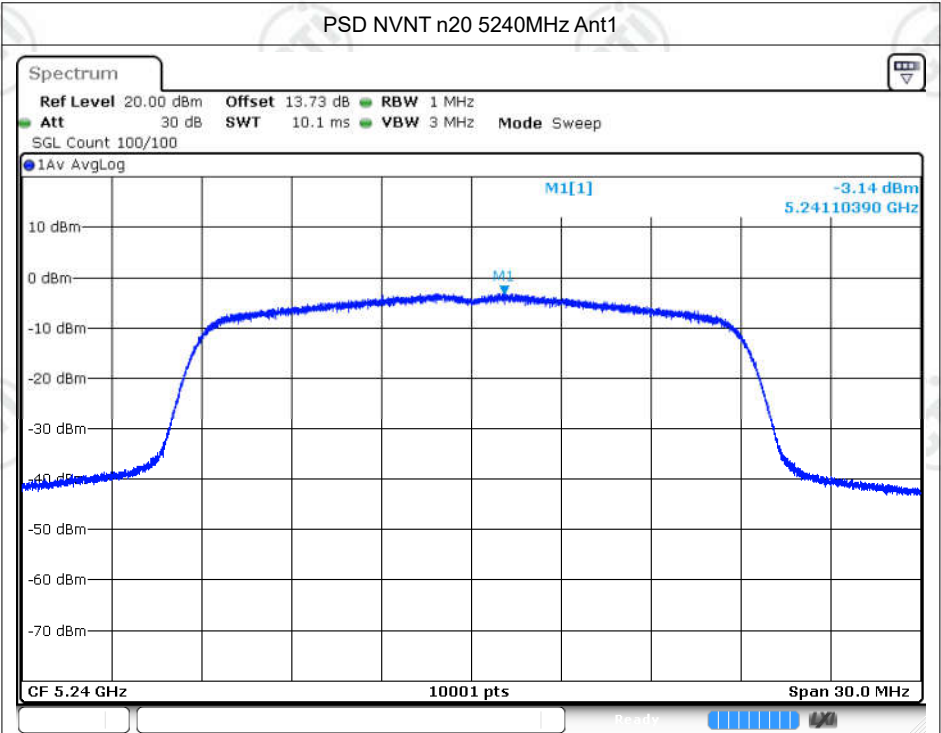


Date: 5.MAY.2024 12:53:55

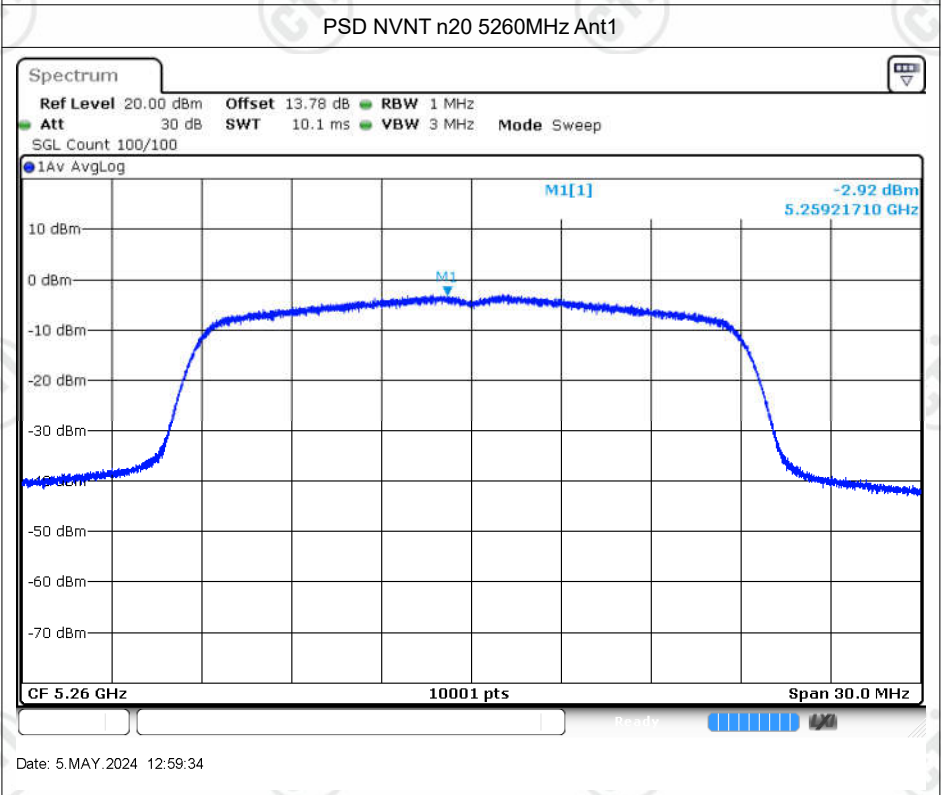


Date: 5.MAY.2024 12:59:34

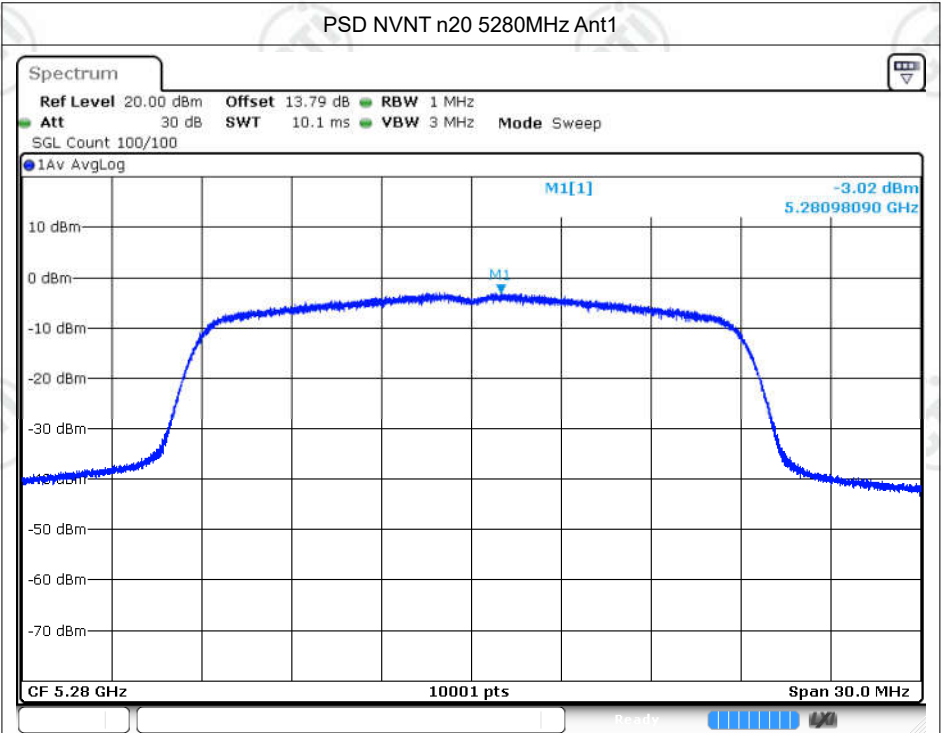


Date: 5.MAY.2024 13:01:03

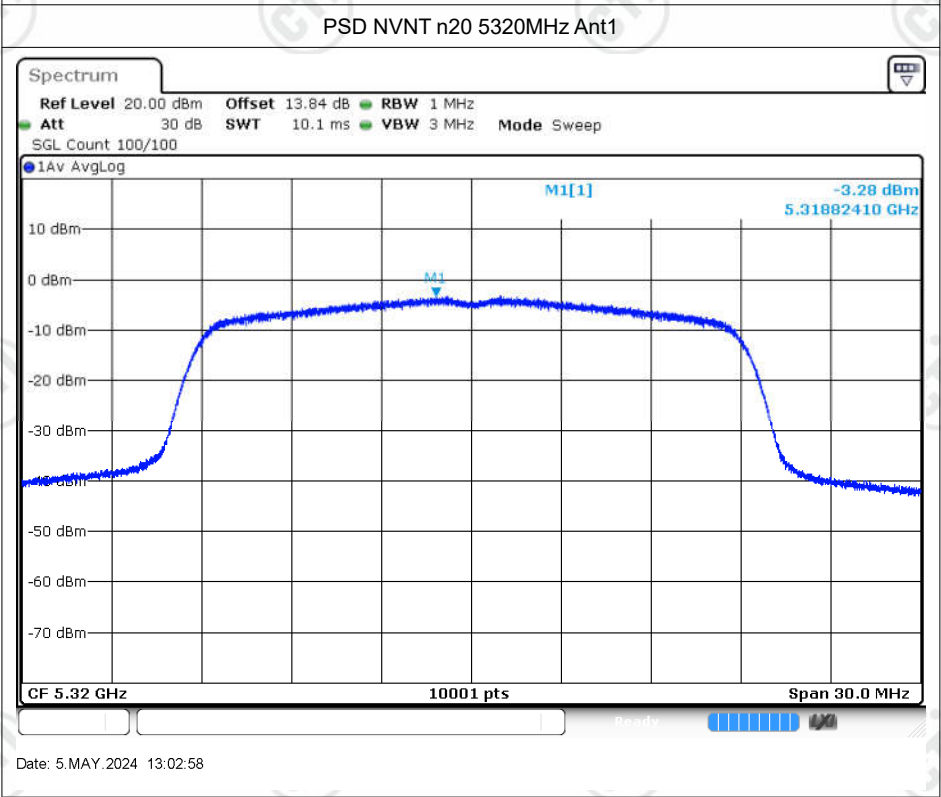


Date: 5.MAY.2024 13:02:58

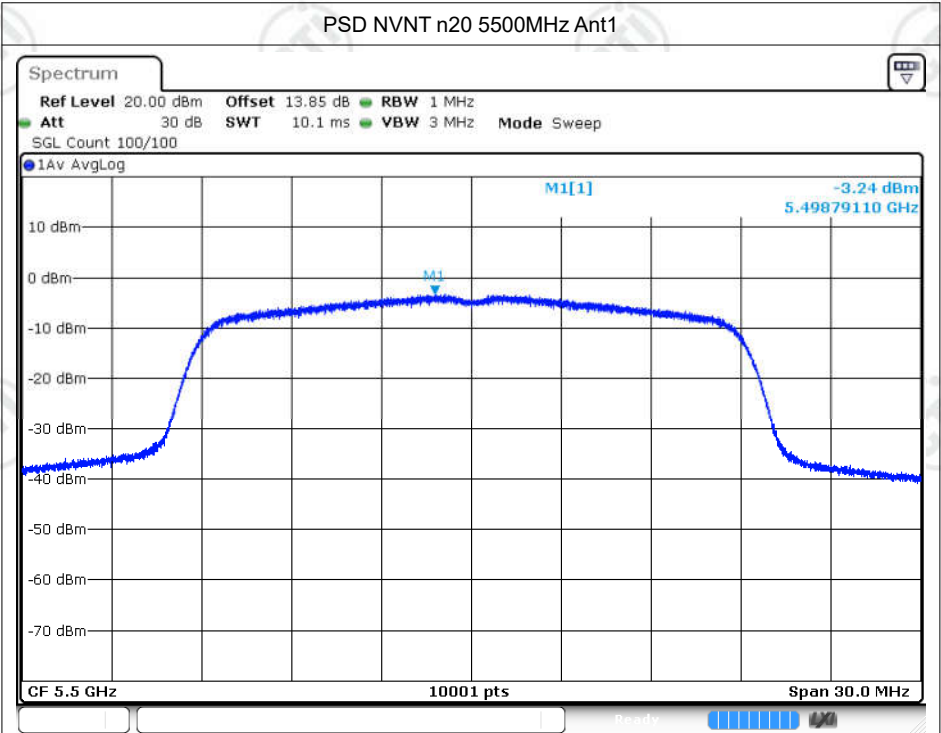


Date: 5.MAY.2024 13:04:43

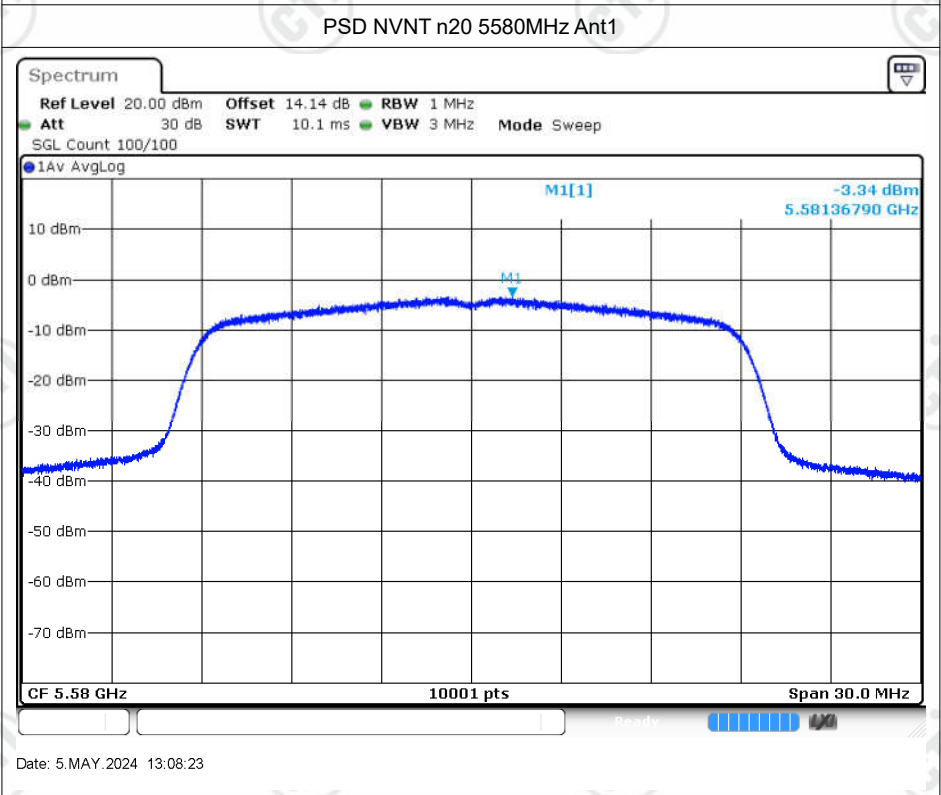


Date: 5.MAY.2024 13:08:23

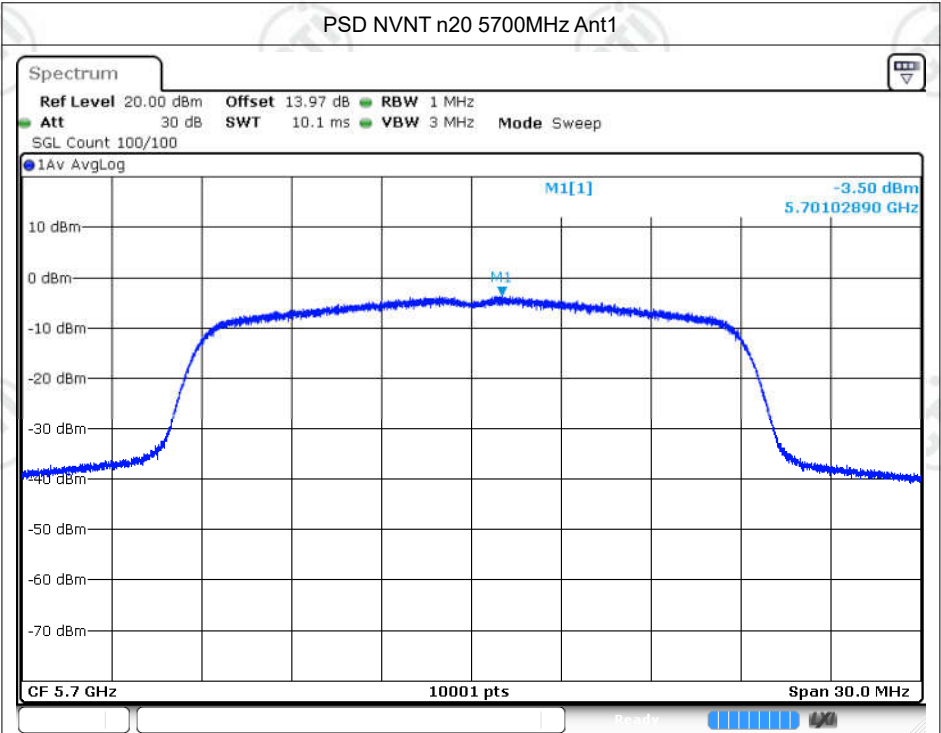


Date: 5.MAY.2024 13:07:08

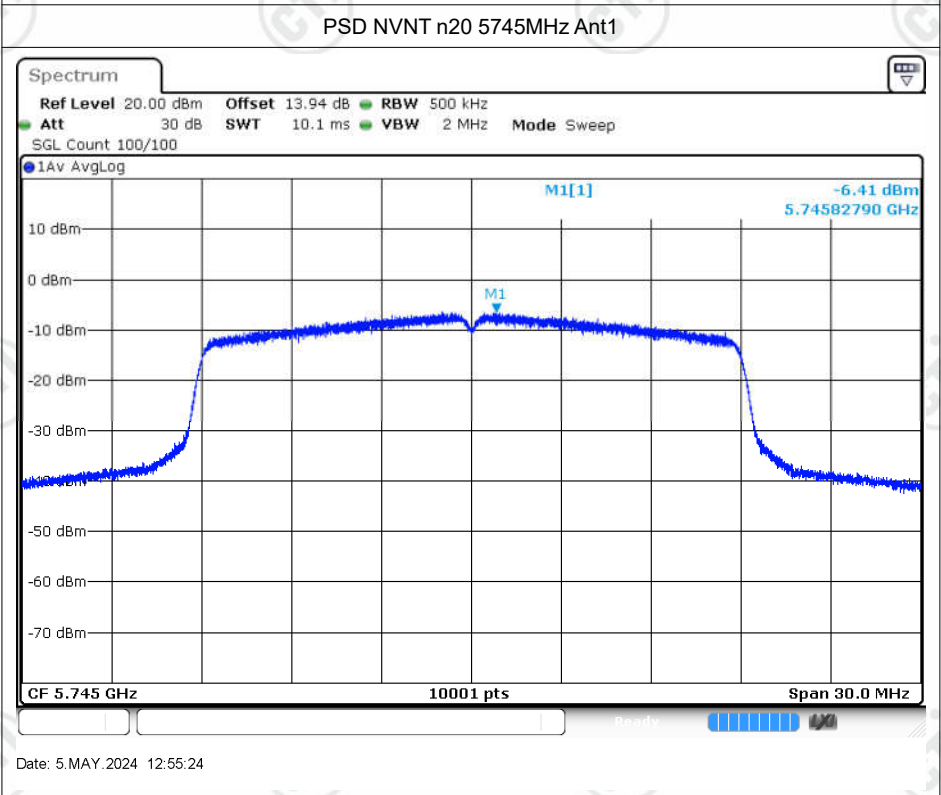


Date: 5.MAY.2024 12:55:24

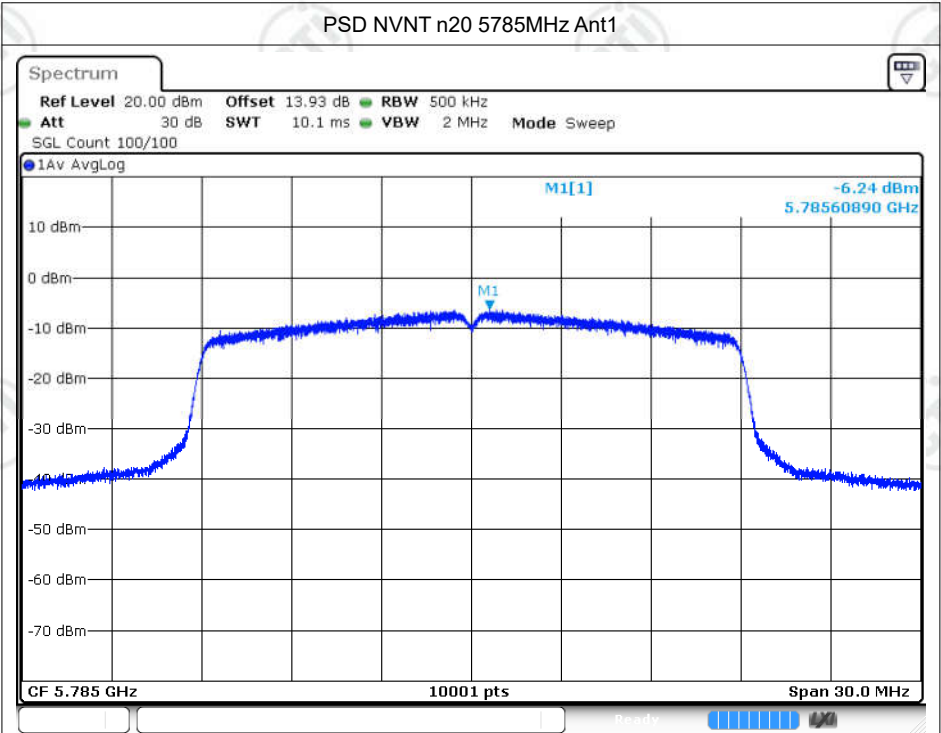


Date: 5.MAY.2024 12:56:55

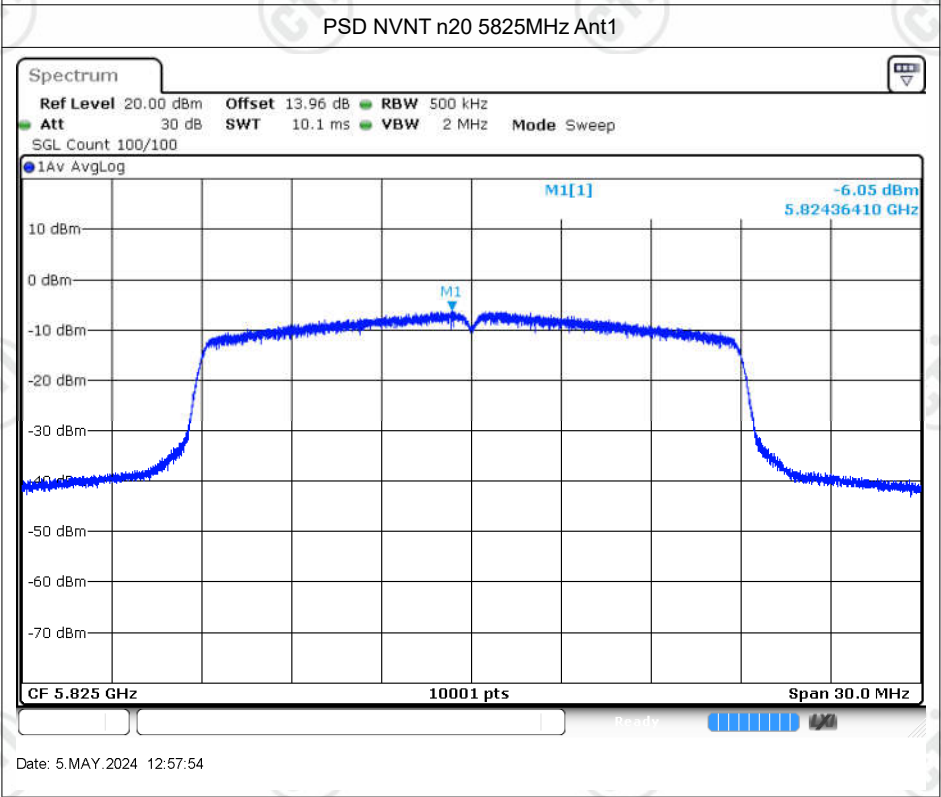


Date: 5.MAY.2024 12:57:54

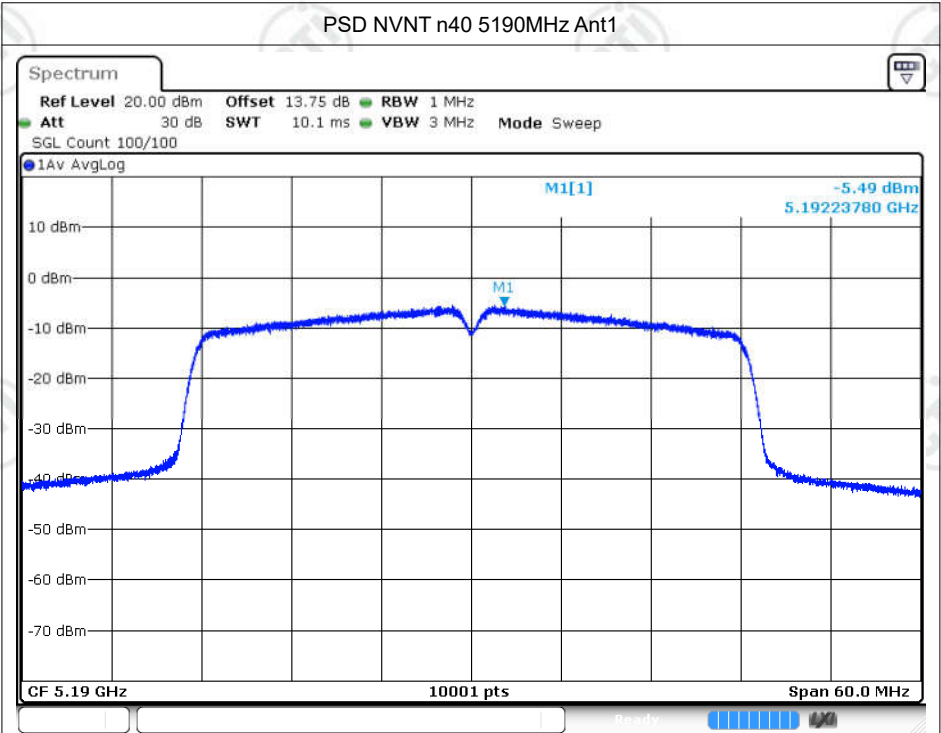


Date: 5.MAY.2024 13:10:37

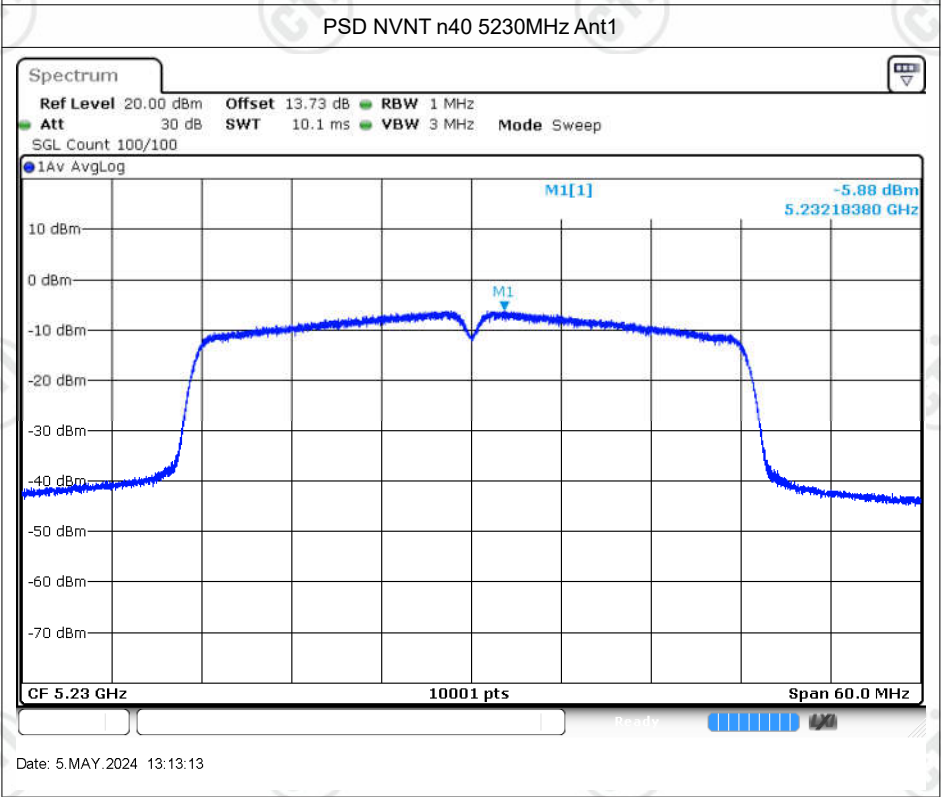


Date: 5.MAY.2024 13:13:13

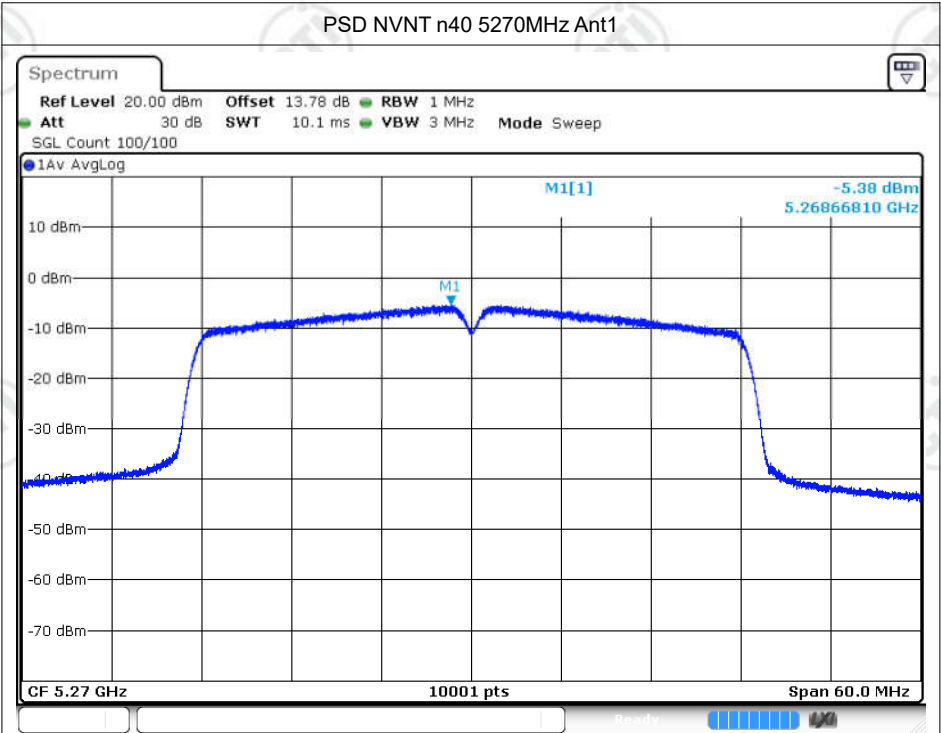


Date: 5.MAY.2024 13:18:39

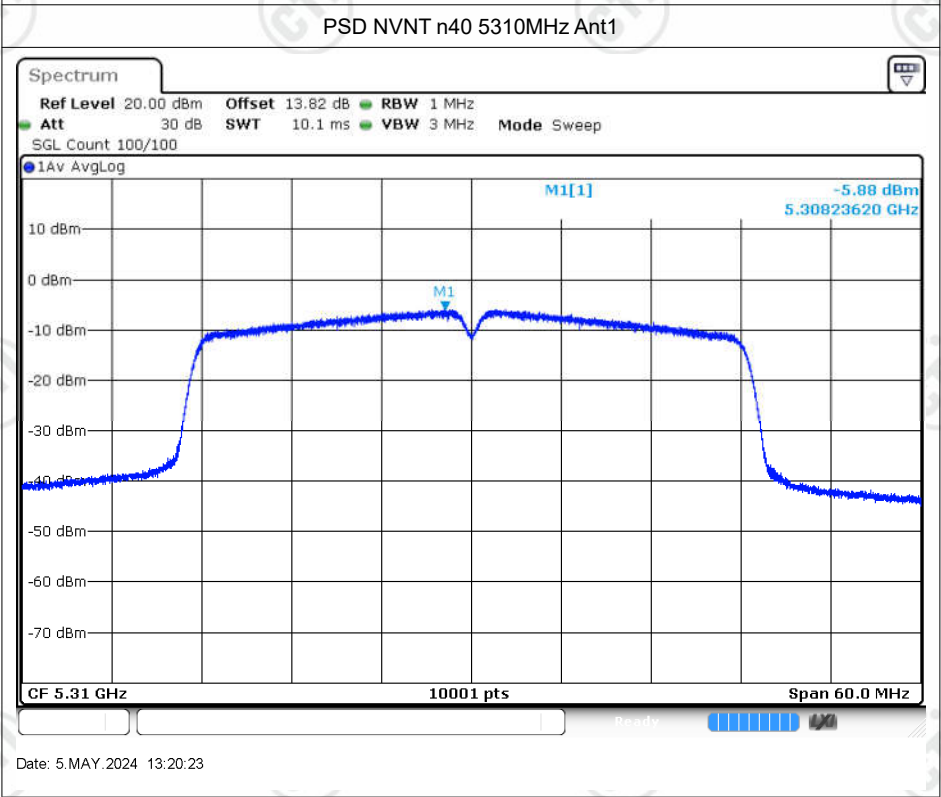


Date: 5.MAY.2024 13:20:23

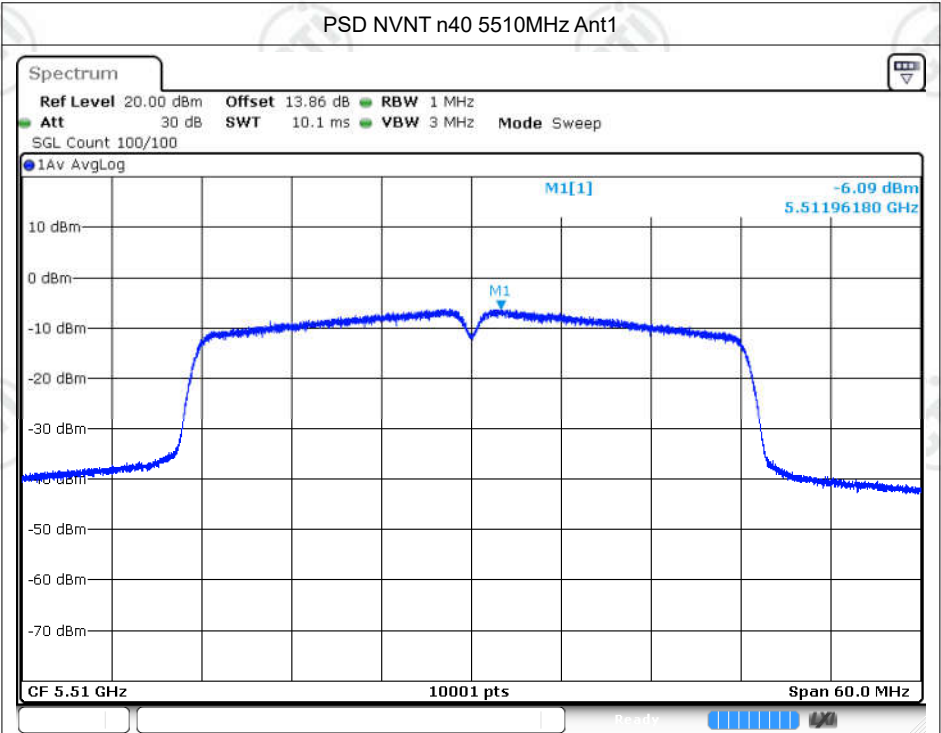


Date: 5.MAY.2024 13:22:17

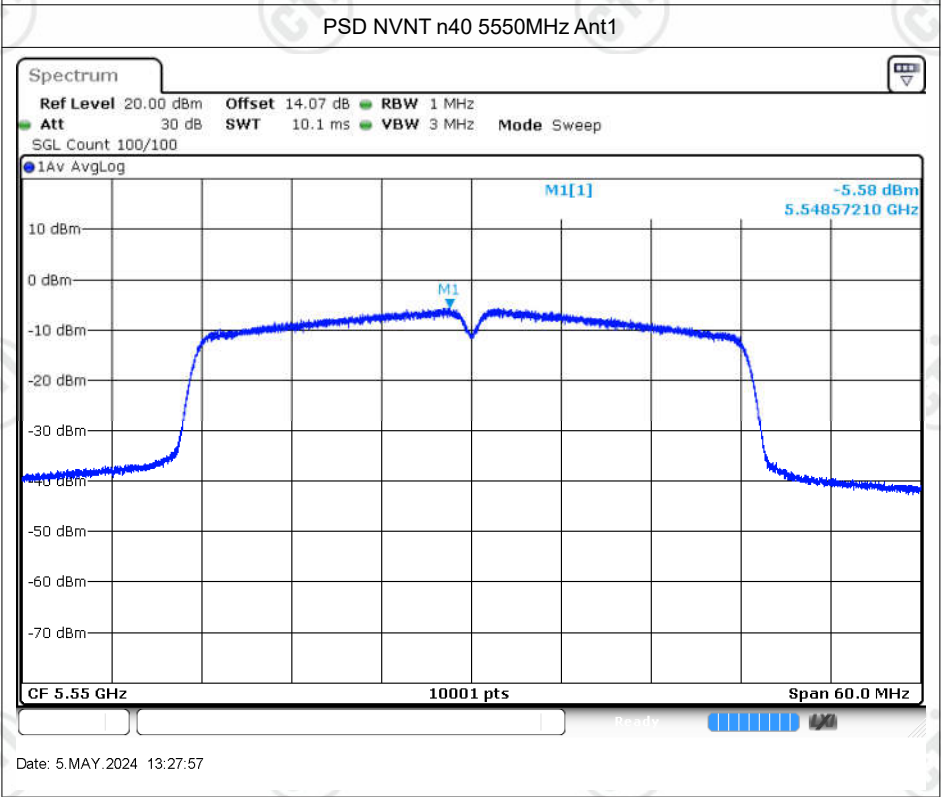


Date: 5.MAY.2024 13:27:57

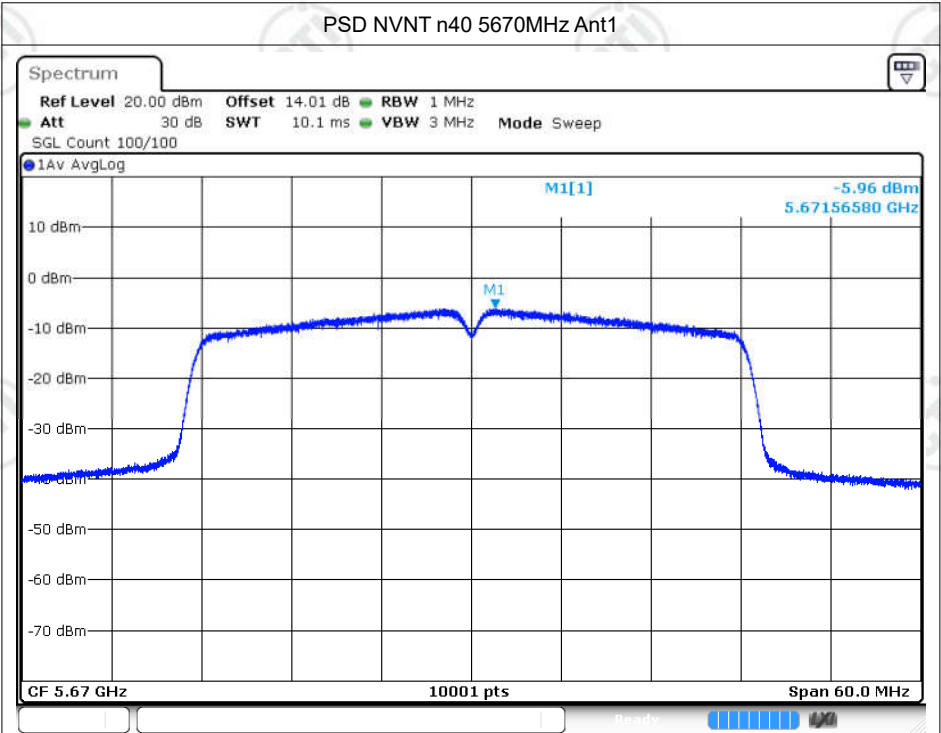


Date: 5.MAY.2024 13:29:51

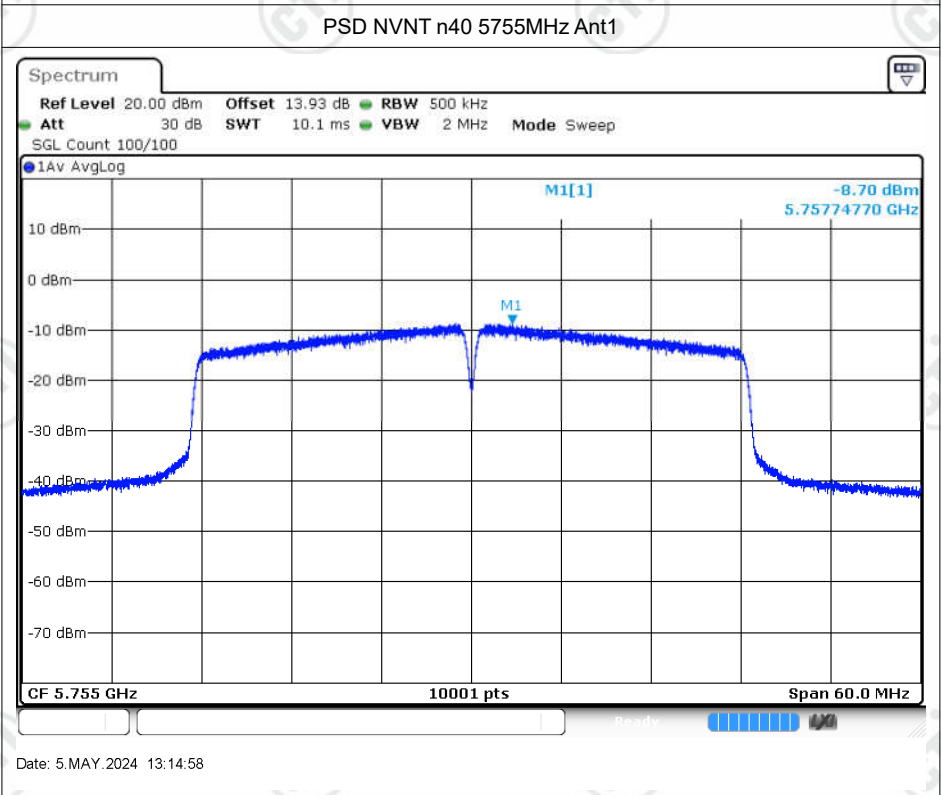


Date: 5.MAY.2024 13:14:58

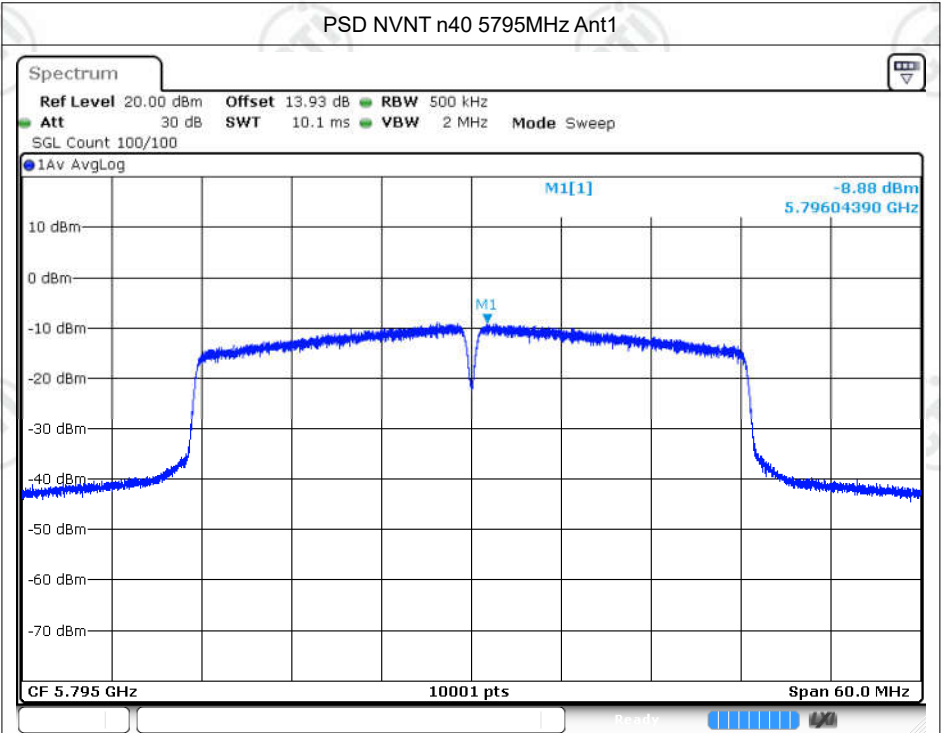


Date: 5.MAY.2024 13:16:54

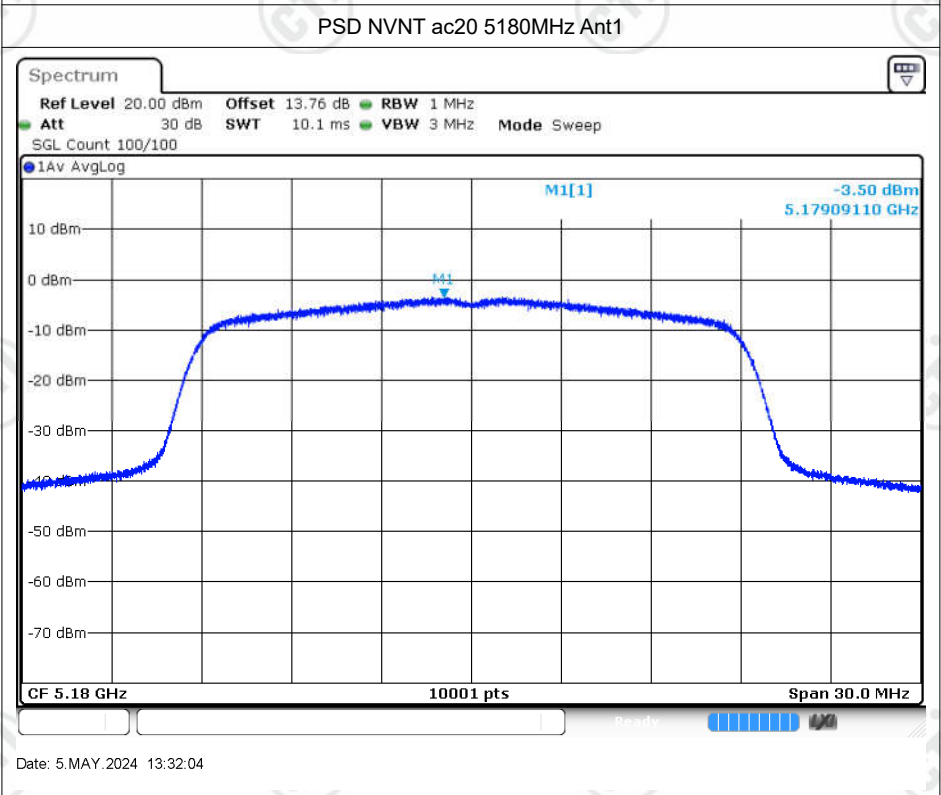


Date: 5.MAY.2024 13:32:04

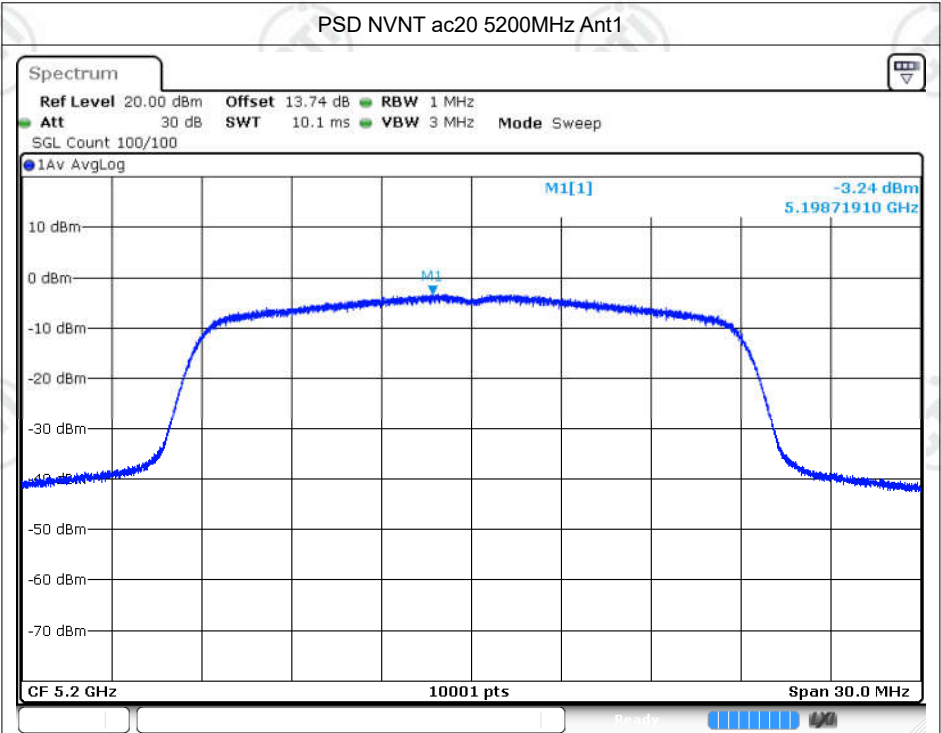


Date: 5.MAY.2024 13:33:35

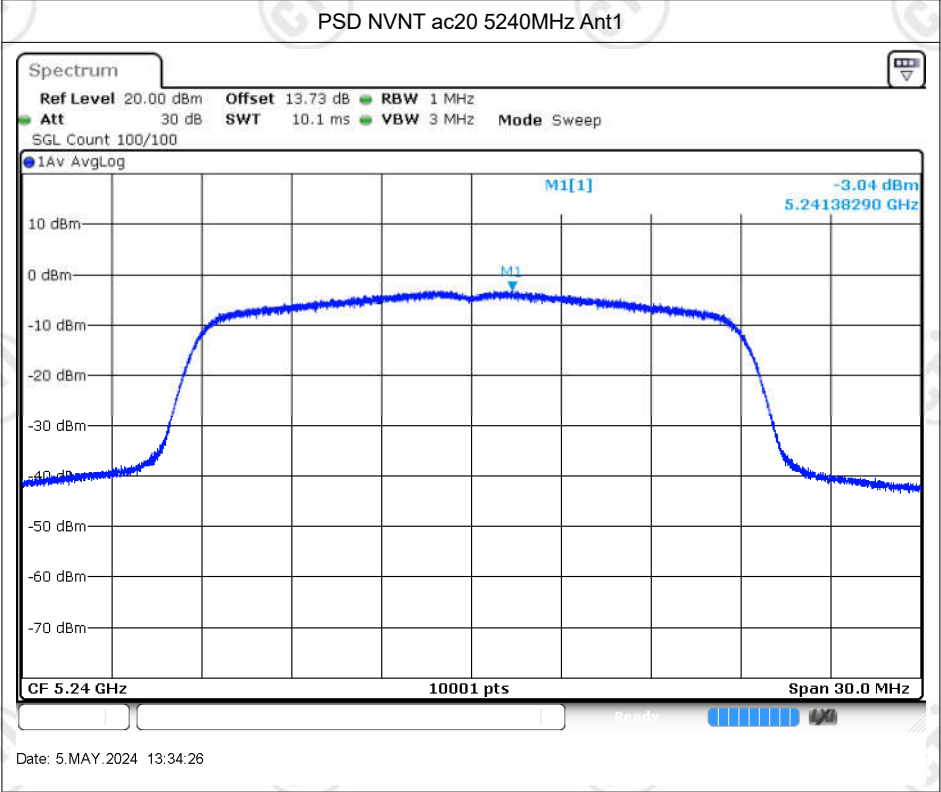


Date: 5.MAY.2024 13:34:26

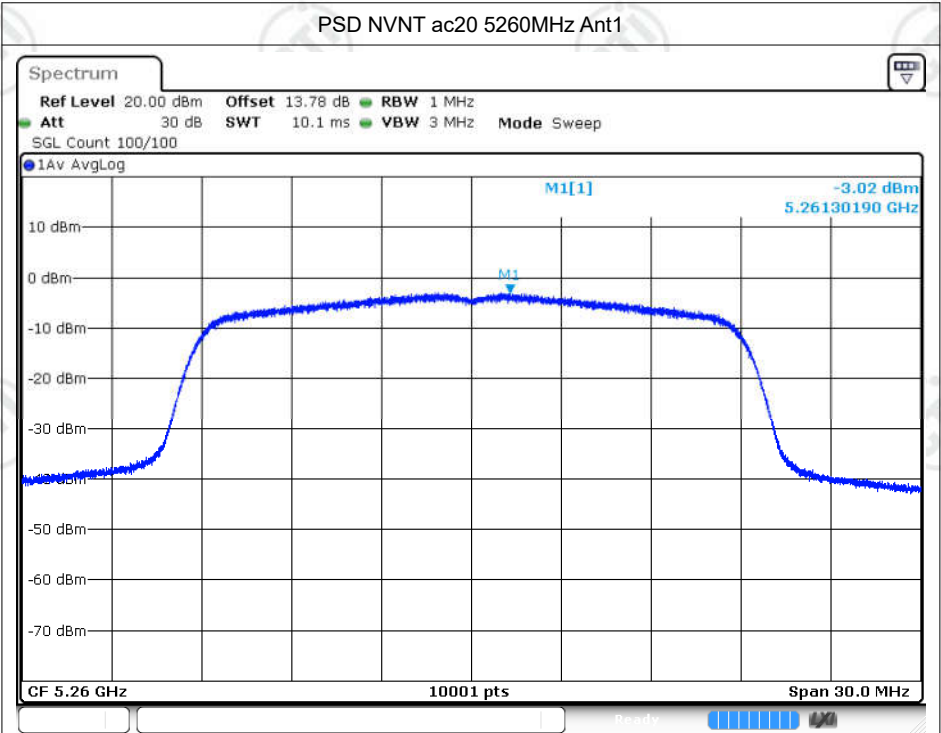


Date: 5.MAY.2024 13:39:51

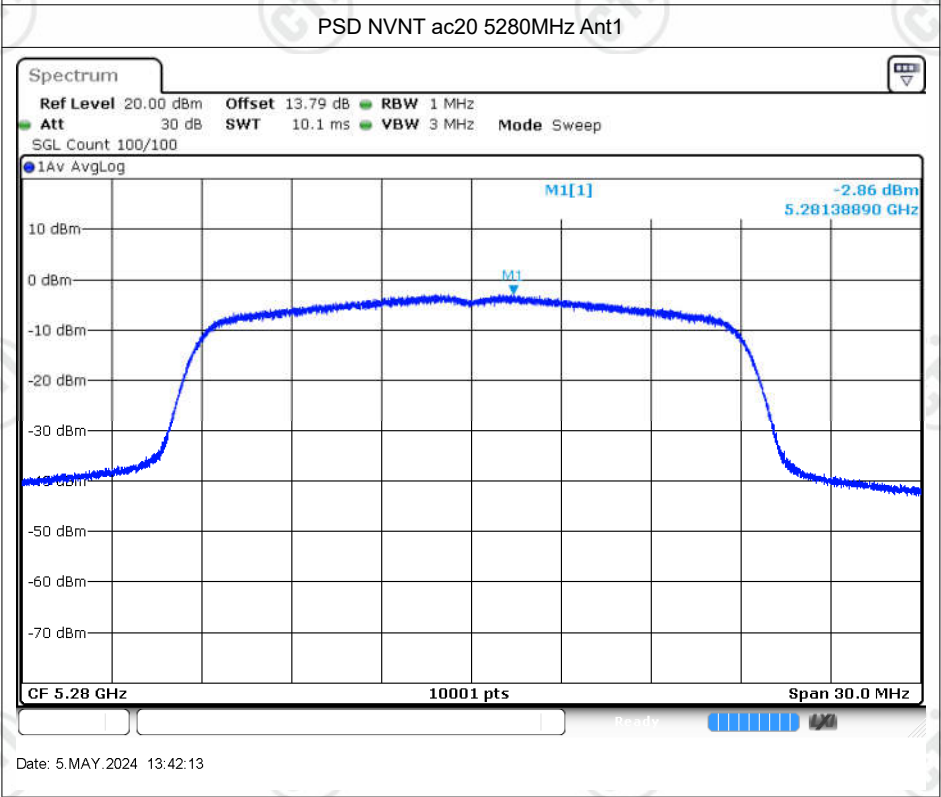


Date: 5.MAY.2024 13:42:13

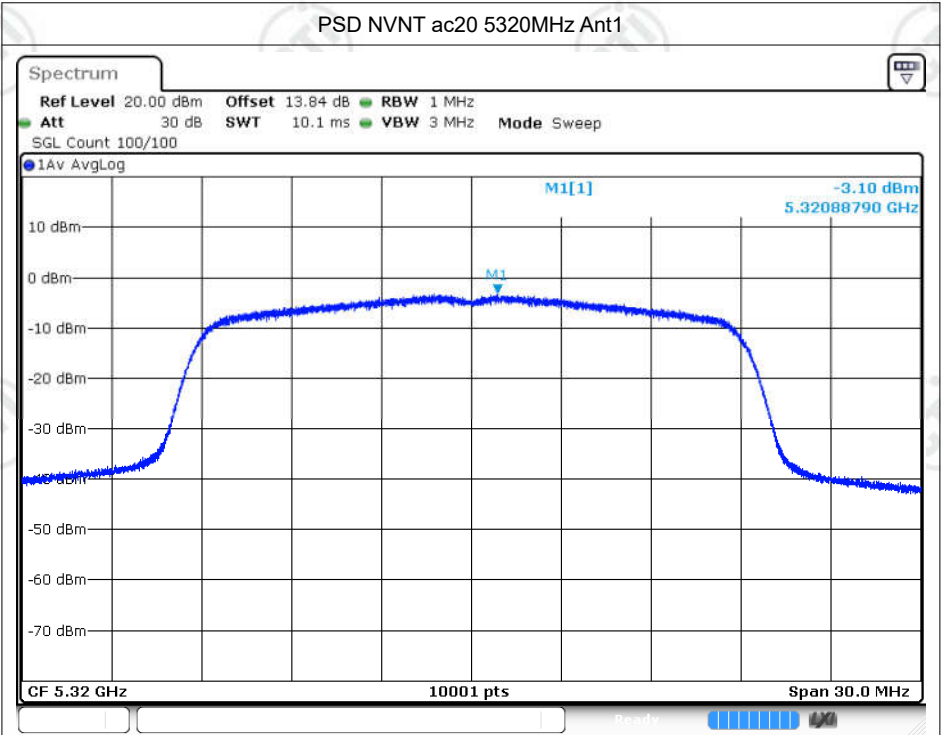


Date: 5.MAY.2024 13:43:57

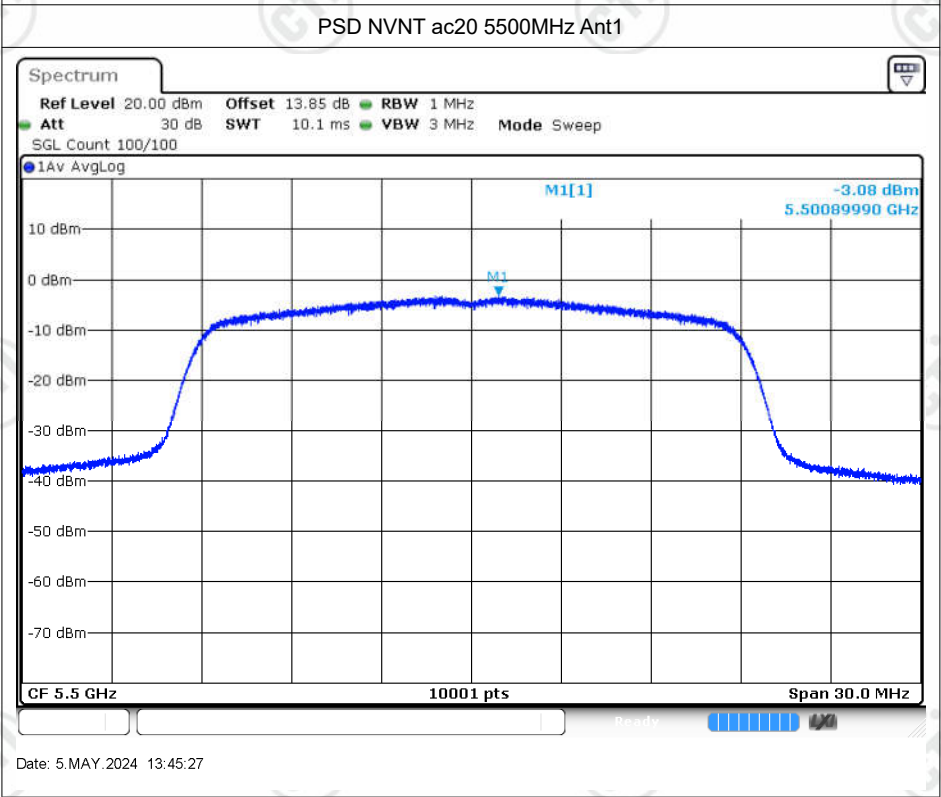


Date: 5.MAY.2024 13:45:27

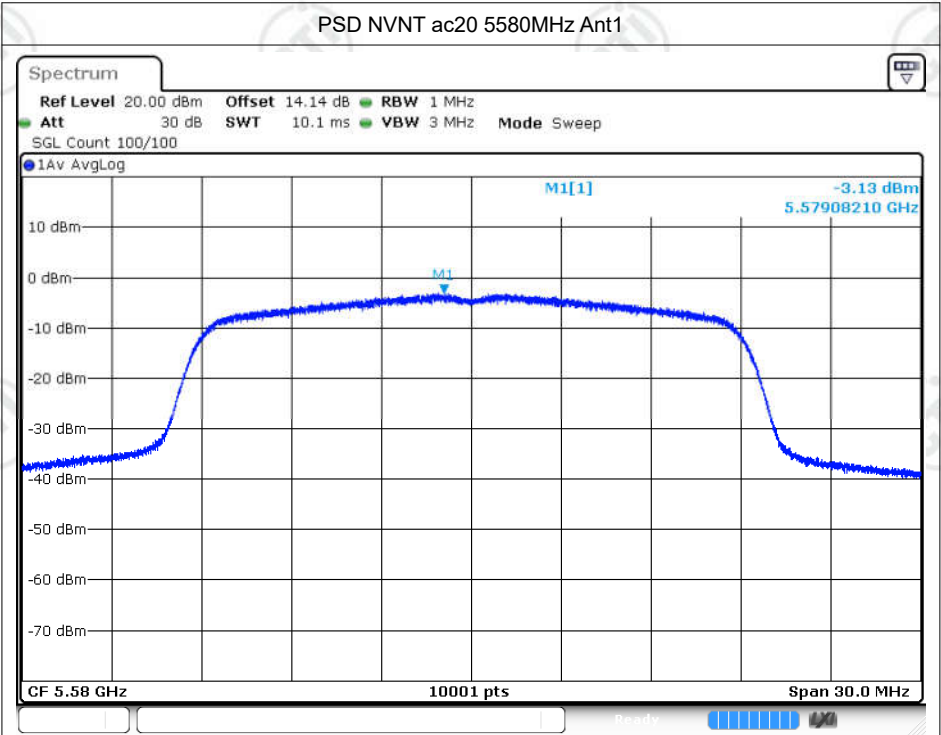


Date: 5.MAY.2024 13:48:32

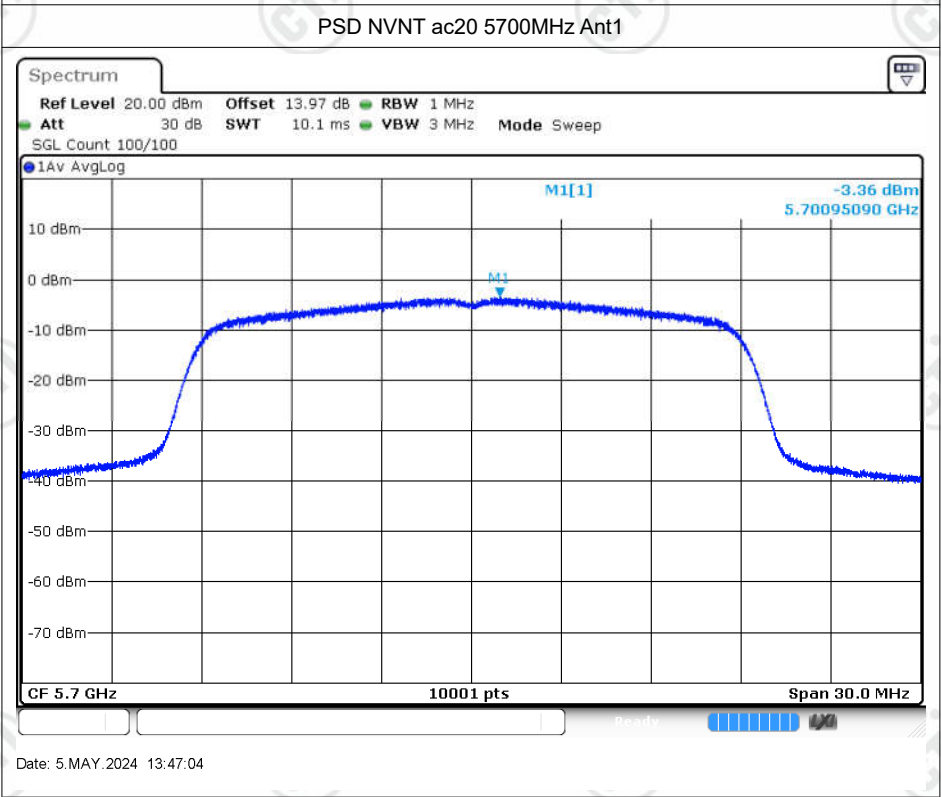


Date: 5.MAY.2024 13:47:04

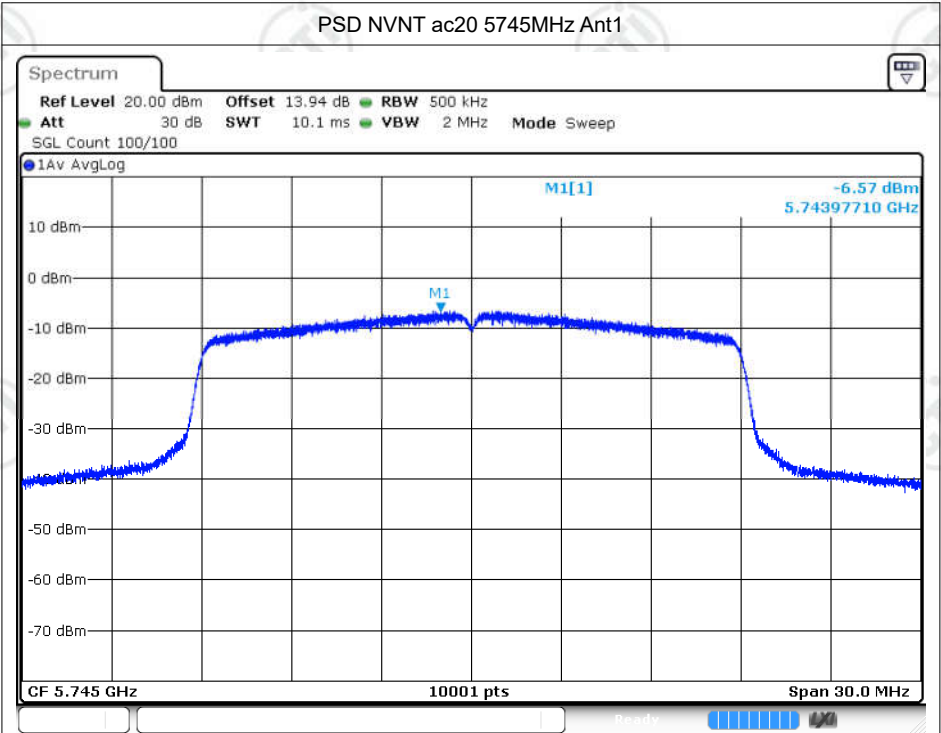


Date: 5.MAY.2024 13:35:56

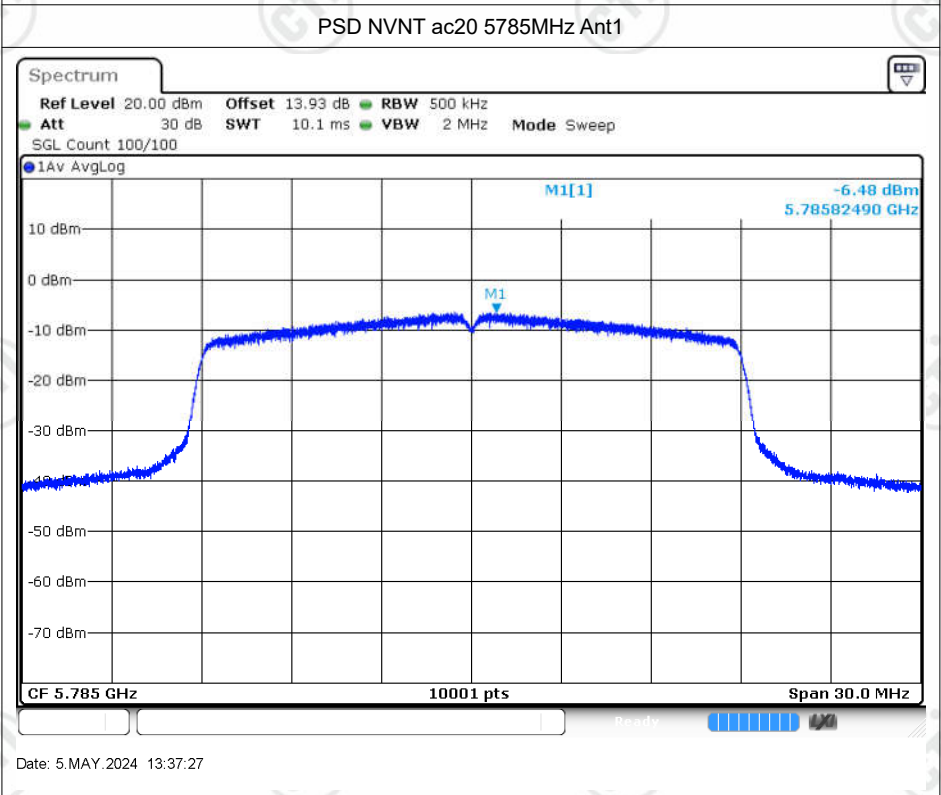


Date: 5.MAY.2024 13:37:27

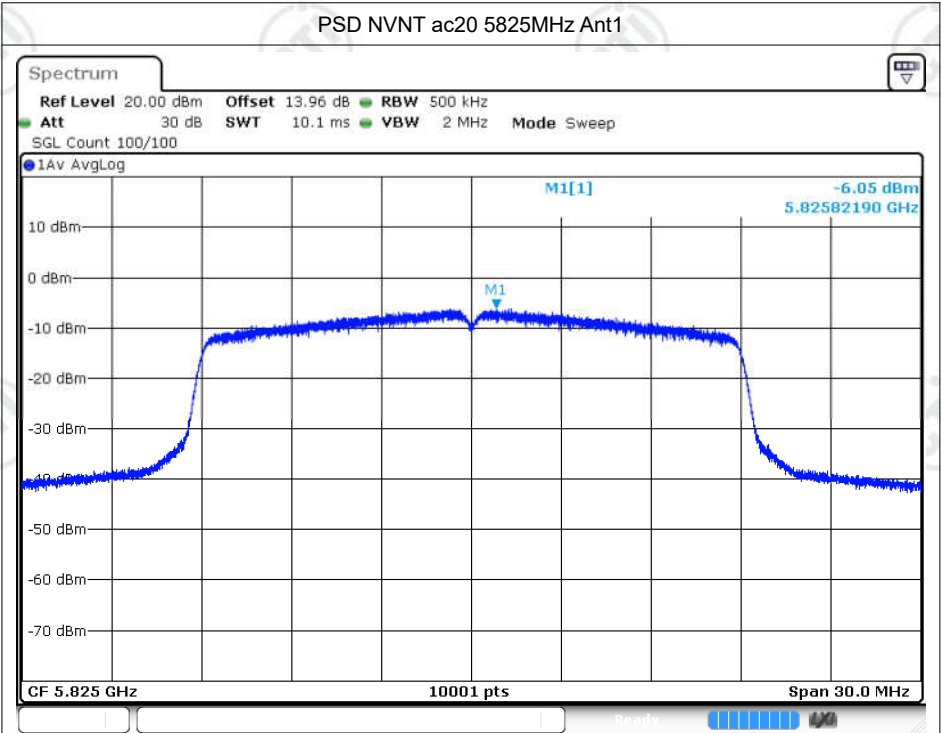


Date: 5.MAY.2024 13:38:17

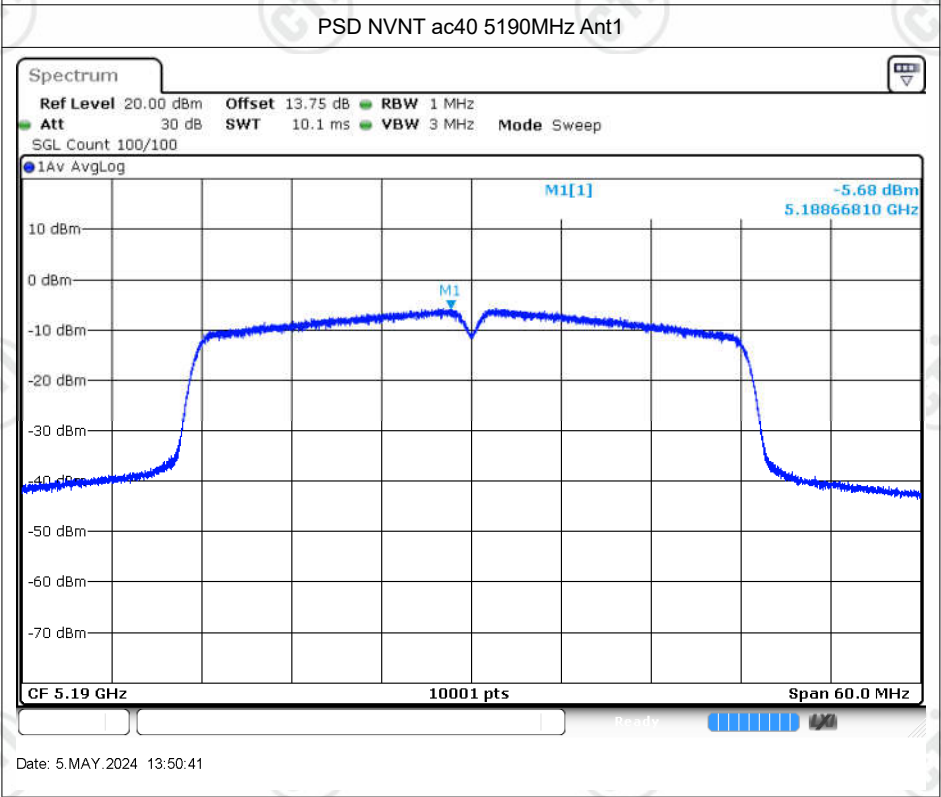


Date: 5.MAY.2024 13:50:41

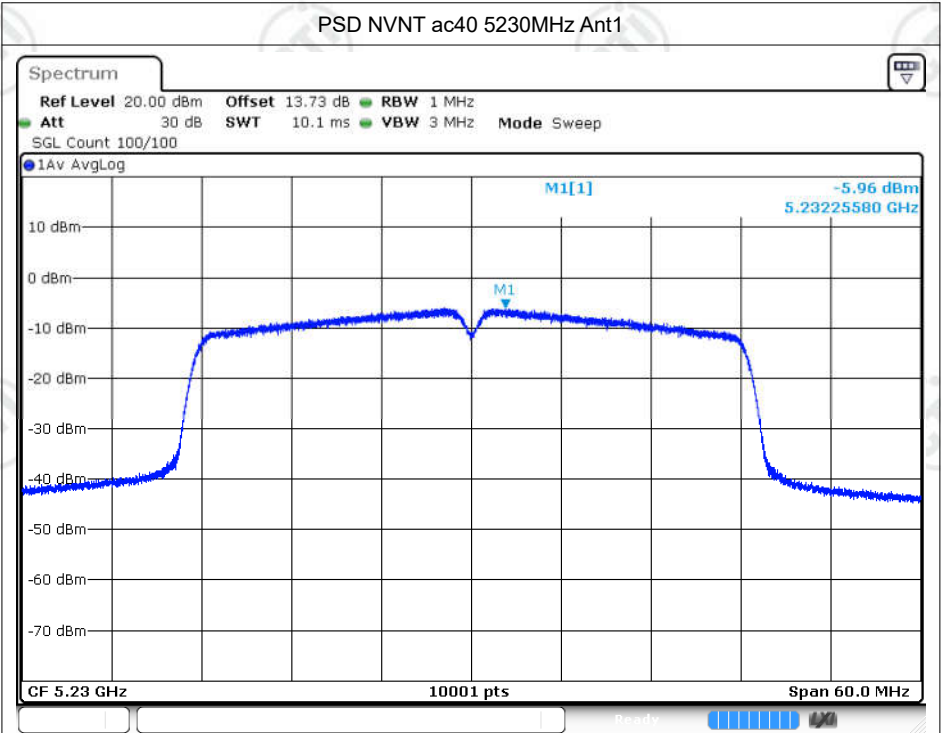


Date: 5.MAY.2024 13:52:29

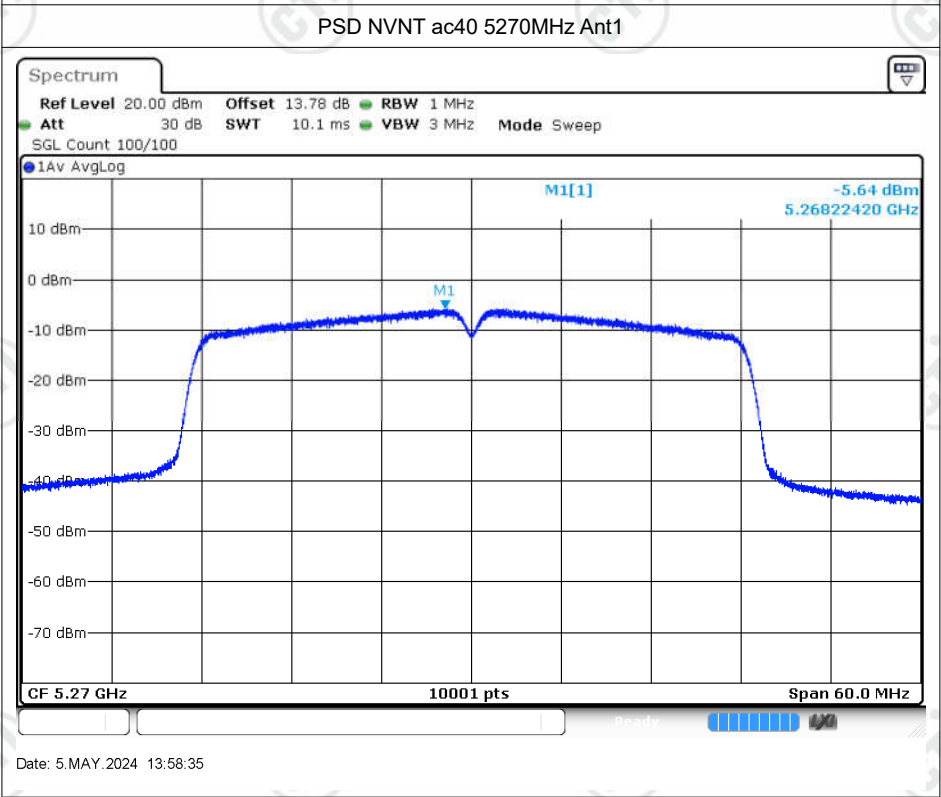


Date: 5.MAY.2024 13:58:35

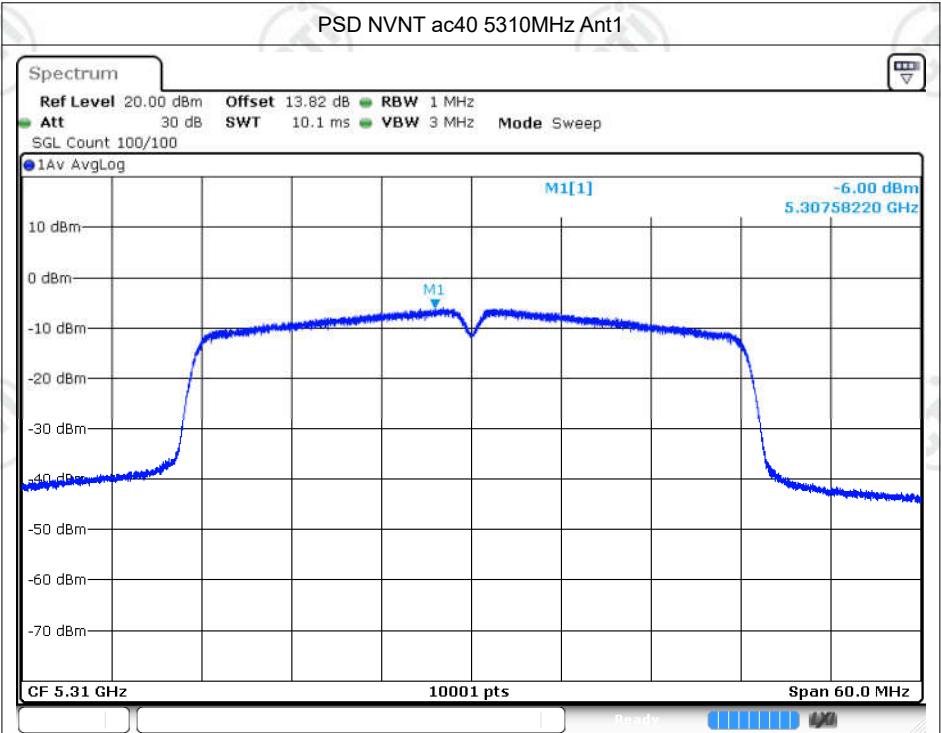


Date: 5.MAY.2024 14:00:24

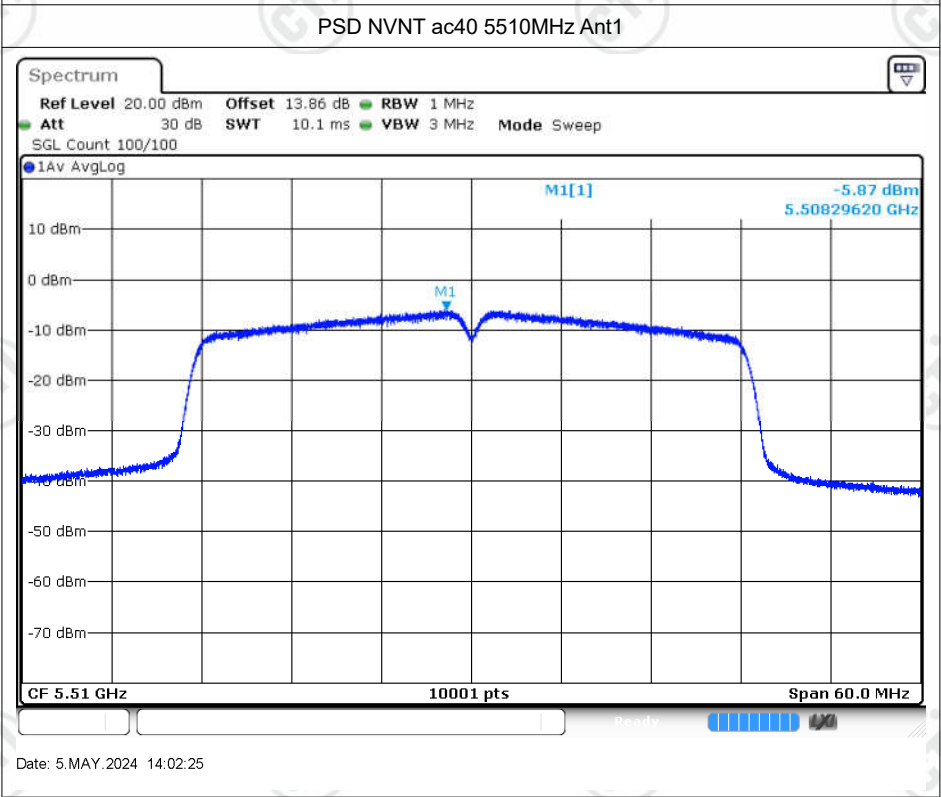


Date: 5.MAY.2024 14:02:25

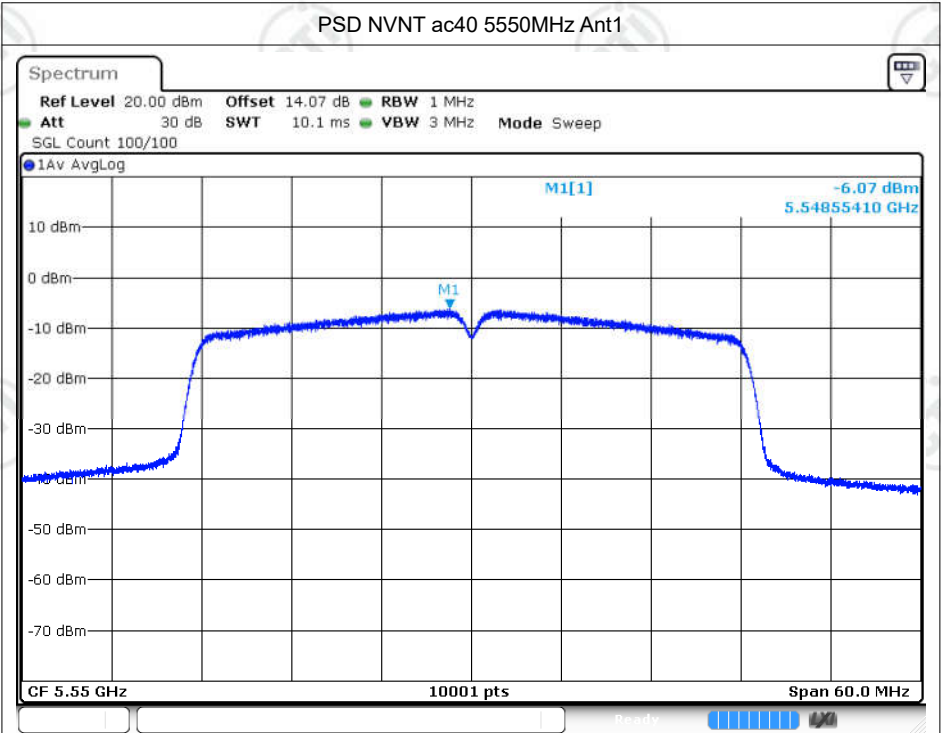


Date: 5.MAY.2024 14:04:18

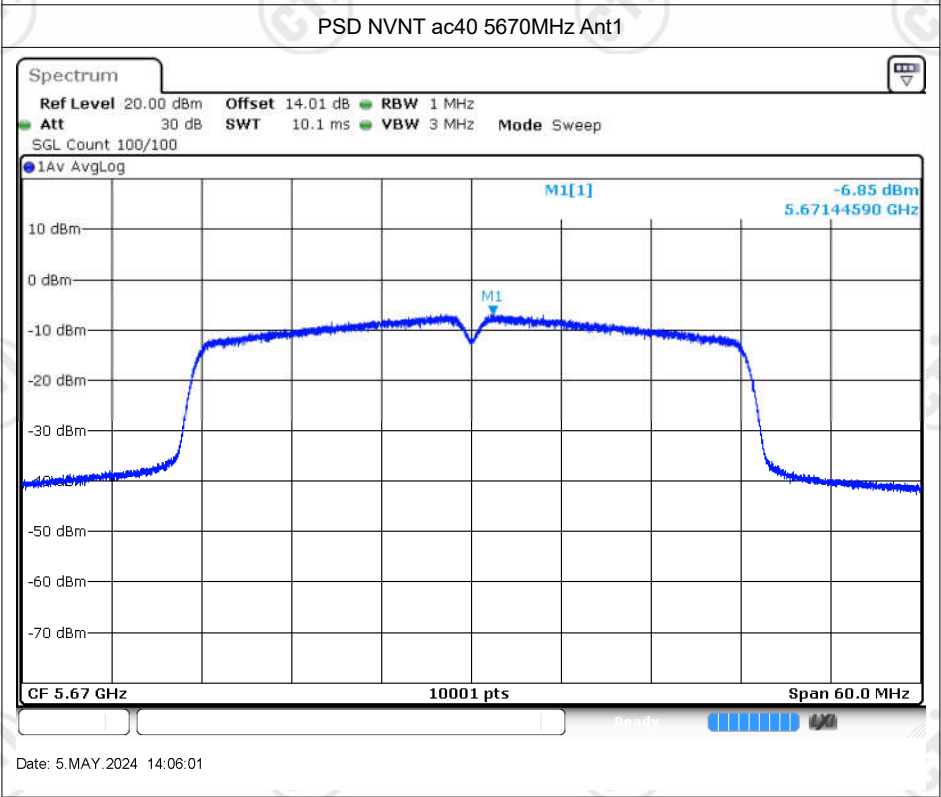


Date: 5.MAY.2024 14:06:01

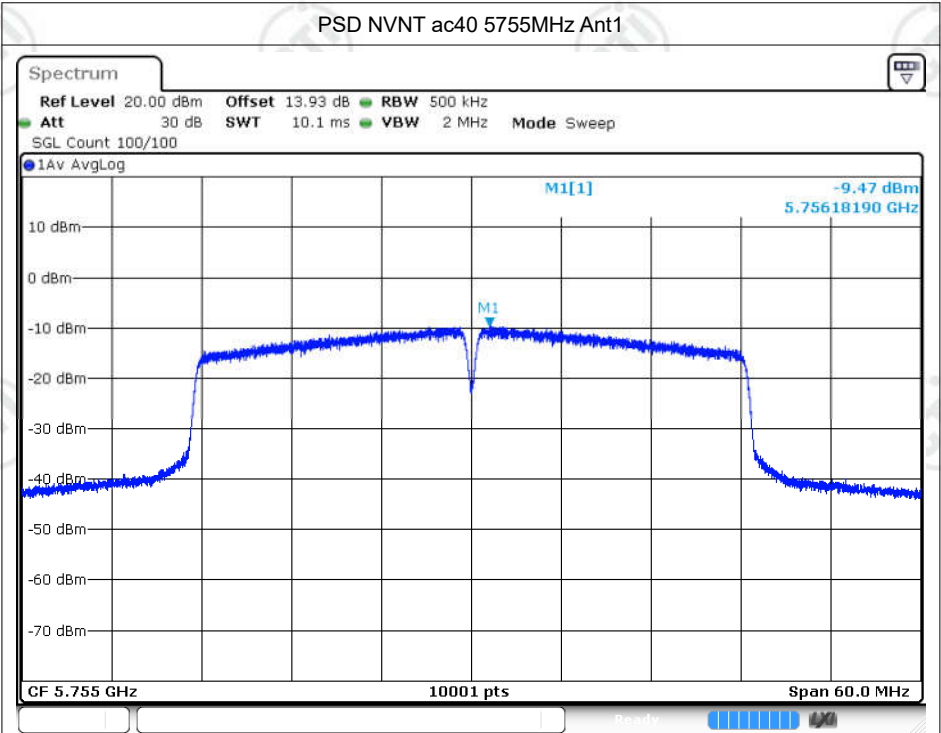


Date: 5.MAY.2024 13:54:29

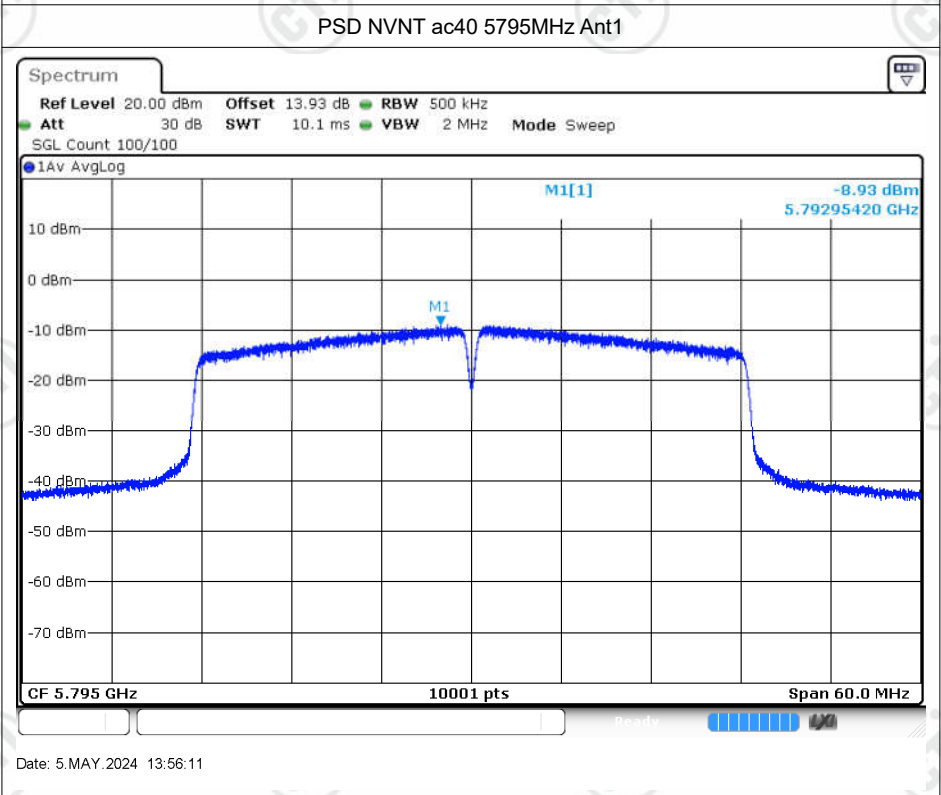


Date: 5.MAY.2024 13:56:11

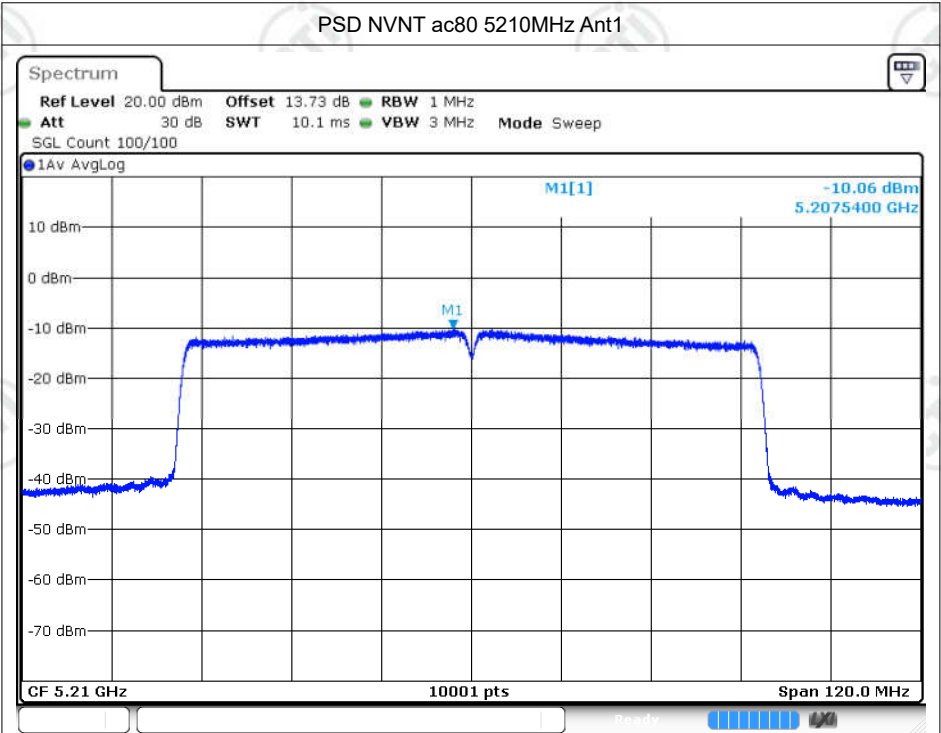


Date: 5.MAY.2024 14:09:45

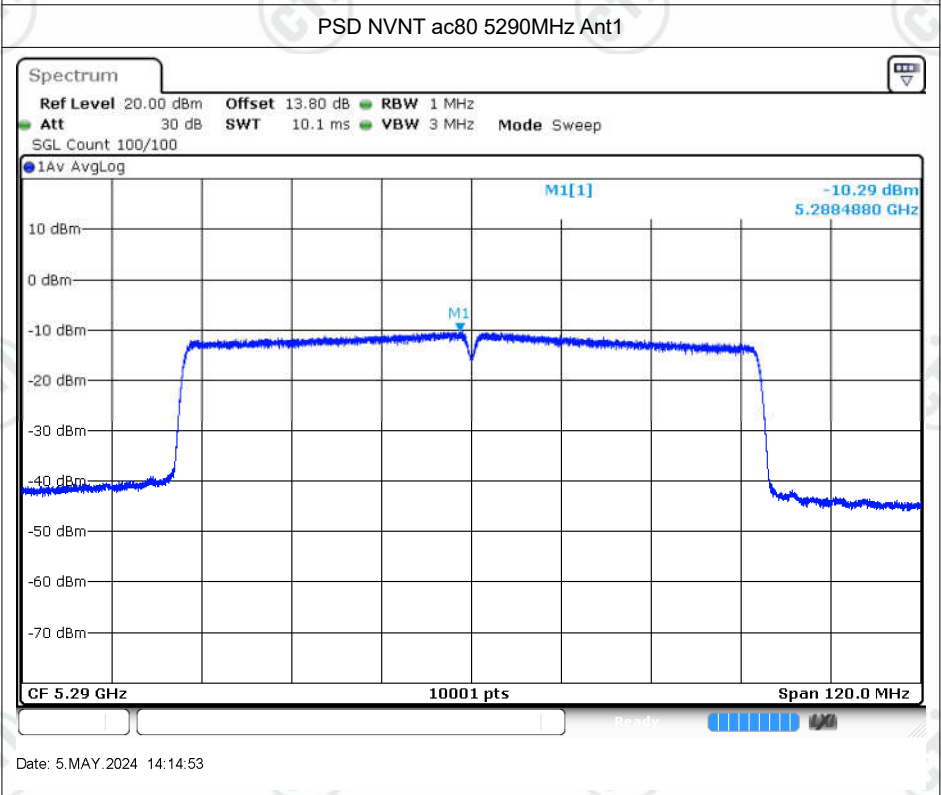

Date: 5.MAY.2024 14:14:53

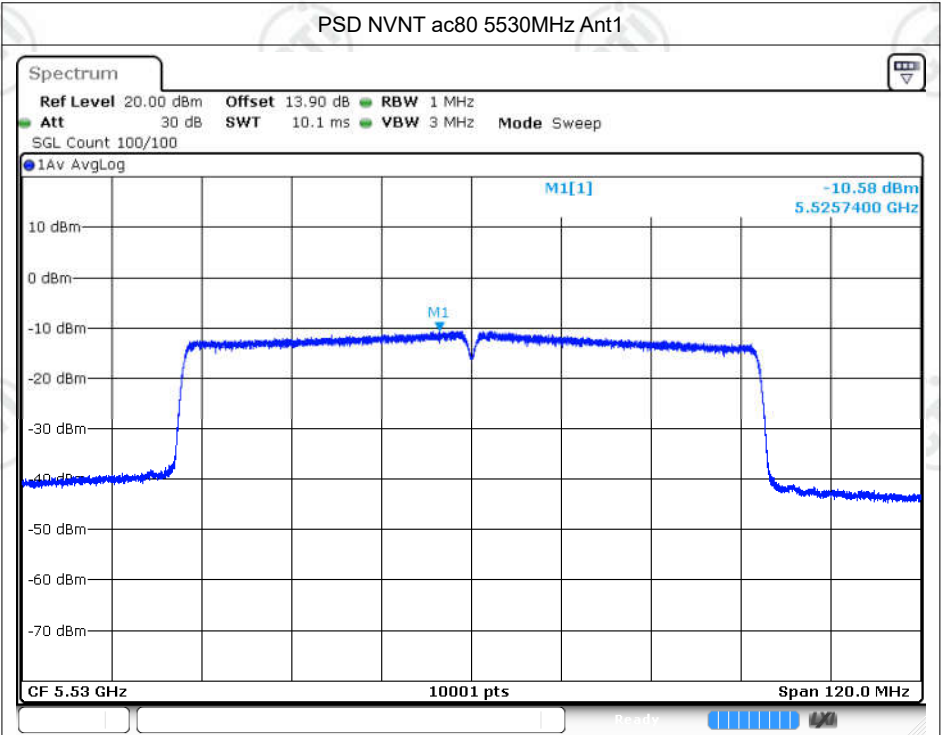

Date: 5.MAY.2024 14:17:20

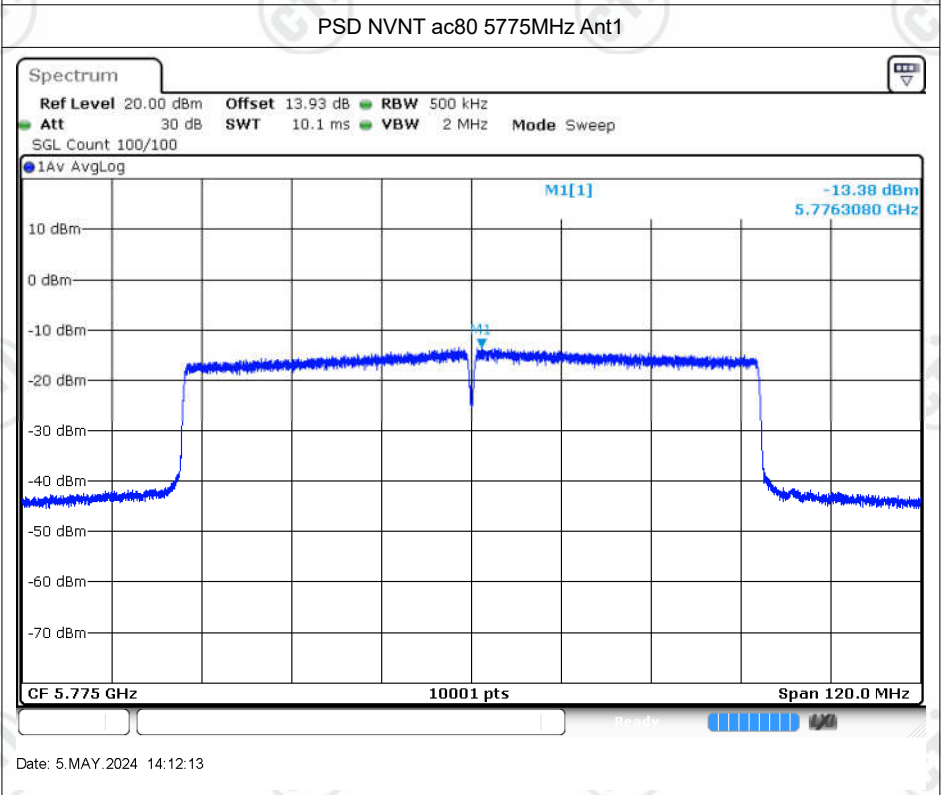

Date: 5.MAY.2024 14:12:13

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 10.2V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 12V	a	5180	Ant1	5180.04	40000	7.72	25	Pass
20C 13.8V	a	5180	Ant1	5180	0	0	25	Pass
-20C 12V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
-10C 12V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
0C 12V	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 12V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 12V	a	5180	Ant1	5180.04	40000	7.72	25	Pass
40C 12V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
50C 12V	a	5180	Ant1	5180	0	0	25	Pass
20C 10.2V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 12V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 13.8V	a	5240	Ant1	5239.96	-40000	-7.63	25	Pass
-20C 12V	a	5240	Ant1	5240	0	0	25	Pass
-10C 12V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 12V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
10C 12V	a	5240	Ant1	5240	0	0	25	Pass
30C 12V	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 12V	a	5240	Ant1	5240	0	0	25	Pass
50C 12V	a	5240	Ant1	5240	0	0	25	Pass
20C 10.2V	a	5260	Ant1	5260.02	20000	3.8	25	Pass
20C 12V	a	5260	Ant1	5260	0	0	25	Pass
20C 13.8V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 12V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-10C 12V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 12V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
10C 12V	a	5260	Ant1	5260.02	20000	3.8	25	Pass
30C 12V	a	5260	Ant1	5259.96	-40000	-7.6	25	Pass
40C 12V	a	5260	Ant1	5260	0	0	25	Pass
50C 12V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 10.2V	a	5280	Ant1	5280.02	20000	3.79	25	Pass
20C 12V	a	5280	Ant1	5280	0	0	25	Pass
20C 13.8V	a	5280	Ant1	5280	0	0	25	Pass
-20C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-10C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
0C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
10C 12V	a	5280	Ant1	5280.02	20000	3.79	25	Pass

30C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 12V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
50C 12V	a	5280	Ant1	5280.02	20000	3.79	25	Pass
20C 10.2V	a	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 12V	a	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 13.8V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-20C 12V	a	5320	Ant1	5320.02	20000	3.76	25	Pass
-10C 12V	a	5320	Ant1	5320	0	0	25	Pass
0C 12V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
10C 12V	a	5320	Ant1	5320	0	0	25	Pass
30C 12V	a	5320	Ant1	5320	0	0	25	Pass
40C 12V	a	5320	Ant1	5320	0	0	25	Pass
50C 12V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 10.2V	a	5500	Ant1	5499.96	-40000	-7.27	25	Pass
20C 12V	a	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 13.8V	a	5500	Ant1	5500	0	0	25	Pass
-20C 12V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-10C 12V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
0C 12V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
10C 12V	a	5500	Ant1	5499.96	-40000	-7.27	25	Pass
30C 12V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
40C 12V	a	5500	Ant1	5500	0	0	25	Pass
50C 12V	a	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 10.2V	a	5580	Ant1	5580.02	20000	3.58	25	Pass
20C 12V	a	5580	Ant1	5580	0	0	25	Pass
20C 13.8V	a	5580	Ant1	5580.02	20000	3.58	25	Pass
-20C 12V	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
-10C 12V	a	5580	Ant1	5580	0	0	25	Pass
0C 12V	a	5580	Ant1	5580.02	20000	3.58	25	Pass
10C 12V	a	5580	Ant1	5580	0	0	25	Pass
30C 12V	a	5580	Ant1	5580.02	20000	3.58	25	Pass
40C 12V	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
50C 12V	a	5580	Ant1	5580	0	0	25	Pass
20C 10.2V	a	5700	Ant1	5700	0	0	25	Pass
20C 12V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 13.8V	a	5700	Ant1	5700.04	40000	7.02	25	Pass
-20C 12V	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-10C 12V	a	5700	Ant1	5699.96	-40000	-7.02	25	Pass
0C 12V	a	5700	Ant1	5700.02	20000	3.51	25	Pass
10C 12V	a	5700	Ant1	5700.02	20000	3.51	25	Pass
30C 12V	a	5700	Ant1	5700.02	20000	3.51	25	Pass

40C 12V	a	5700	Ant1	5700.02	20000	3.51	25	Pass
50C 12V	a	5700	Ant1	5700	0	0	25	Pass
20C 10.2V	a	5745	Ant1	5745	0	0	25	Pass
20C 12V	a	5745	Ant1	5745	0	0	25	Pass
20C 13.8V	a	5745	Ant1	5745	0	0	25	Pass
-20C 12V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
-10C 12V	a	5745	Ant1	5745	0	0	25	Pass
0C 12V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 12V	a	5745	Ant1	5745	0	0	25	Pass
30C 12V	a	5745	Ant1	5745	0	0	25	Pass
40C 12V	a	5745	Ant1	5745	0	0	25	Pass
50C 12V	a	5745	Ant1	5744.98	-20000	-3.48	25	Pass
20C 10.2V	a	5825	Ant1	5825	0	0	25	Pass
20C 12V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 13.8V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
-20C 12V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
-10C 12V	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
0C 12V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
10C 12V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
30C 12V	a	5825	Ant1	5824.96	-40000	-6.87	25	Pass
40C 12V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
50C 12V	a	5825	Ant1	5825	0	0	25	Pass
20C 10.2V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 12V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 13.8V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
-20C 12V	n20	5180	Ant1	5180	0	0	25	Pass
-10C 12V	n20	5180	Ant1	5180	0	0	25	Pass
0C 12V	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
10C 12V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 12V	n20	5180	Ant1	5180	0	0	25	Pass
40C 12V	n20	5180	Ant1	5180	0	0	25	Pass
50C 12V	n20	5180	Ant1	5180	0	0	25	Pass
20C 10.2V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
20C 12V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 13.8V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-20C 12V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-10C 12V	n20	5240	Ant1	5240	0	0	25	Pass
0C 12V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
10C 12V	n20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
30C 12V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
40C 12V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass

50C 12V	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 10.2V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 12V	n20	5260	Ant1	5260	0	0	25	Pass
20C 13.8V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 12V	n20	5260	Ant1	5260.02	20000	3.8	25	Pass
-10C 12V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 12V	n20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
10C 12V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
30C 12V	n20	5260	Ant1	5260.02	20000	3.8	25	Pass
40C 12V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
50C 12V	n20	5260	Ant1	5260.02	20000	3.8	25	Pass
20C 10.2V	n20	5280	Ant1	5280	0	0	25	Pass
20C 12V	n20	5280	Ant1	5280	0	0	25	Pass
20C 13.8V	n20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
-20C 12V	n20	5280	Ant1	5280	0	0	25	Pass
-10C 12V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
0C 12V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
10C 12V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
30C 12V	n20	5280	Ant1	5280	0	0	25	Pass
40C 12V	n20	5280	Ant1	5280	0	0	25	Pass
50C 12V	n20	5280	Ant1	5280.02	20000	3.79	25	Pass
20C 10.2V	n20	5320	Ant1	5320	0	0	25	Pass
20C 12V	n20	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 13.8V	n20	5320	Ant1	5320	0	0	25	Pass
-20C 12V	n20	5320	Ant1	5320	0	0	25	Pass
-10C 12V	n20	5320	Ant1	5320	0	0	25	Pass
0C 12V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
10C 12V	n20	5320	Ant1	5320	0	0	25	Pass
30C 12V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
40C 12V	n20	5320	Ant1	5320	0	0	25	Pass
50C 12V	n20	5320	Ant1	5319.94	-60000	-11.28	25	Pass
20C 10.2V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 12V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 13.8V	n20	5500	Ant1	5500	0	0	25	Pass
-20C 12V	n20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
-10C 12V	n20	5500	Ant1	5500.02	20000	3.64	25	Pass
0C 12V	n20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
10C 12V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
30C 12V	n20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
40C 12V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
50C 12V	n20	5500	Ant1	5500	0	0	25	Pass

20C 10.2V	n20	5580	Ant1	5580	0	0	25	Pass
20C 12V	n20	5580	Ant1	5580	0	0	25	Pass
20C 13.8V	n20	5580	Ant1	5580.02	20000	3.58	25	Pass
-20C 12V	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
-10C 12V	n20	5580	Ant1	5580	0	0	25	Pass
0C 12V	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
10C 12V	n20	5580	Ant1	5580	0	0	25	Pass
30C 12V	n20	5580	Ant1	5580	0	0	25	Pass
40C 12V	n20	5580	Ant1	5580	0	0	25	Pass
50C 12V	n20	5580	Ant1	5580	0	0	25	Pass
20C 10.2V	n20	5700	Ant1	5700	0	0	25	Pass
20C 12V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 13.8V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
-20C 12V	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-10C 12V	n20	5700	Ant1	5700.04	40000	7.02	25	Pass
0C 12V	n20	5700	Ant1	5700	0	0	25	Pass
10C 12V	n20	5700	Ant1	5700	0	0	25	Pass
30C 12V	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
40C 12V	n20	5700	Ant1	5700	0	0	25	Pass
50C 12V	n20	5700	Ant1	5700	0	0	25	Pass
20C 10.2V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 12V	n20	5745	Ant1	5745	0	0	25	Pass
20C 13.8V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
-20C 12V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
-10C 12V	n20	5745	Ant1	5745	0	0	25	Pass
0C 12V	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
10C 12V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
30C 12V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
40C 12V	n20	5745	Ant1	5745	0	0	25	Pass
50C 12V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 10.2V	n20	5825	Ant1	5825	0	0	25	Pass
20C 12V	n20	5825	Ant1	5825	0	0	25	Pass
20C 13.8V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
-20C 12V	n20	5825	Ant1	5825	0	0	25	Pass
-10C 12V	n20	5825	Ant1	5825	0	0	25	Pass
0C 12V	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
10C 12V	n20	5825	Ant1	5825	0	0	25	Pass
30C 12V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
40C 12V	n20	5825	Ant1	5825	0	0	25	Pass
50C 12V	n20	5825	Ant1	5825	0	0	25	Pass
20C 10.2V	n40	5190	Ant1	5190	0	0	25	Pass

20C 12V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
20C 13.8V	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
-20C 12V	n40	5190	Ant1	5190	0	0	25	Pass
-10C 12V	n40	5190	Ant1	5190	0	0	25	Pass
0C 12V	n40	5190	Ant1	5190	0	0	25	Pass
10C 12V	n40	5190	Ant1	5190	0	0	25	Pass
30C 12V	n40	5190	Ant1	5190	0	0	25	Pass
40C 12V	n40	5190	Ant1	5190	0	0	25	Pass
50C 12V	n40	5190	Ant1	5190	0	0	25	Pass
20C 10.2V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 12V	n40	5230	Ant1	5230	0	0	25	Pass
20C 13.8V	n40	5230	Ant1	5230	0	0	25	Pass
-20C 12V	n40	5230	Ant1	5230	0	0	25	Pass
-10C 12V	n40	5230	Ant1	5230	0	0	25	Pass
0C 12V	n40	5230	Ant1	5230	0	0	25	Pass
10C 12V	n40	5230	Ant1	5230	0	0	25	Pass
30C 12V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
40C 12V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
50C 12V	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
20C 10.2V	n40	5270	Ant1	5270	0	0	25	Pass
20C 12V	n40	5270	Ant1	5270	0	0	25	Pass
20C 13.8V	n40	5270	Ant1	5270	0	0	25	Pass
-20C 12V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
-10C 12V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
0C 12V	n40	5270	Ant1	5270	0	0	25	Pass
10C 12V	n40	5270	Ant1	5270	0	0	25	Pass
30C 12V	n40	5270	Ant1	5270	0	0	25	Pass
40C 12V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
50C 12V	n40	5270	Ant1	5270	0	0	25	Pass
20C 10.2V	n40	5310	Ant1	5310	0	0	25	Pass
20C 12V	n40	5310	Ant1	5310	0	0	25	Pass
20C 13.8V	n40	5310	Ant1	5310	0	0	25	Pass
-20C 12V	n40	5310	Ant1	5310	0	0	25	Pass
-10C 12V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
0C 12V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
10C 12V	n40	5310	Ant1	5310	0	0	25	Pass
30C 12V	n40	5310	Ant1	5310	0	0	25	Pass
40C 12V	n40	5310	Ant1	5310	0	0	25	Pass
50C 12V	n40	5310	Ant1	5310	0	0	25	Pass
20C 10.2V	n40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
20C 12V	n40	5510	Ant1	5509.96	-40000	-7.26	25	Pass

20C 13.8V	n40	5510	Ant1	5510	0	0	25	Pass
-20C 12V	n40	5510	Ant1	5510	0	0	25	Pass
-10C 12V	n40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
0C 12V	n40	5510	Ant1	5510	0	0	25	Pass
10C 12V	n40	5510	Ant1	5510	0	0	25	Pass
30C 12V	n40	5510	Ant1	5510	0	0	25	Pass
40C 12V	n40	5510	Ant1	5510	0	0	25	Pass
50C 12V	n40	5510	Ant1	5510	0	0	25	Pass
20C 10.2V	n40	5550	Ant1	5549.84	-160000	-28.83	25	Pass
20C 12V	n40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
20C 13.8V	n40	5550	Ant1	5550	0	0	25	Pass
-20C 12V	n40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
-10C 12V	n40	5550	Ant1	5550	0	0	25	Pass
0C 12V	n40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
10C 12V	n40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
30C 12V	n40	5550	Ant1	5550	0	0	25	Pass
40C 12V	n40	5550	Ant1	5550	0	0	25	Pass
50C 12V	n40	5550	Ant1	5550	0	0	25	Pass
20C 10.2V	n40	5670	Ant1	5670.04	40000	7.05	25	Pass
20C 12V	n40	5670	Ant1	5670	0	0	25	Pass
20C 13.8V	n40	5670	Ant1	5670	0	0	25	Pass
-20C 12V	n40	5670	Ant1	5670	0	0	25	Pass
-10C 12V	n40	5670	Ant1	5670	0	0	25	Pass
0C 12V	n40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
10C 12V	n40	5670	Ant1	5670	0	0	25	Pass
30C 12V	n40	5670	Ant1	5670	0	0	25	Pass
40C 12V	n40	5670	Ant1	5670	0	0	25	Pass
50C 12V	n40	5670	Ant1	5670.04	40000	7.05	25	Pass
20C 10.2V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 12V	n40	5755	Ant1	5755	0	0	25	Pass
20C 13.8V	n40	5755	Ant1	5755	0	0	25	Pass
-20C 12V	n40	5755	Ant1	5755	0	0	25	Pass
-10C 12V	n40	5755	Ant1	5755	0	0	25	Pass
0C 12V	n40	5755	Ant1	5755	0	0	25	Pass
10C 12V	n40	5755	Ant1	5755	0	0	25	Pass
30C 12V	n40	5755	Ant1	5755	0	0	25	Pass
40C 12V	n40	5755	Ant1	5755	0	0	25	Pass
50C 12V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 10.2V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 12V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 13.8V	n40	5795	Ant1	5795	0	0	25	Pass

-20C 12V	n40	5795	Ant1	5795	0	0	25	Pass
-10C 12V	n40	5795	Ant1	5795.2	200000	34.51	25	Pass
0C 12V	n40	5795	Ant1	5795	0	0	25	Pass
10C 12V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
30C 12V	n40	5795	Ant1	5795	0	0	25	Pass
40C 12V	n40	5795	Ant1	5795	0	0	25	Pass
50C 12V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 10.2V	ac20	5180	Ant1	5180	0	0	25	Pass
20C 12V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 13.8V	ac20	5180	Ant1	5180	0	0	25	Pass
-20C 12V	ac20	5180	Ant1	5180	0	0	25	Pass
-10C 12V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
0C 12V	ac20	5180	Ant1	5180	0	0	25	Pass
10C 12V	ac20	5180	Ant1	5180	0	0	25	Pass
30C 12V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
40C 12V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
50C 12V	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
20C 10.2V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 12V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
20C 13.8V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
-20C 12V	ac20	5240	Ant1	5240	0	0	25	Pass
-10C 12V	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
0C 12V	ac20	5240	Ant1	5240	0	0	25	Pass
10C 12V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
30C 12V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
40C 12V	ac20	5240	Ant1	5240	0	0	25	Pass
50C 12V	ac20	5240	Ant1	5240	0	0	25	Pass
20C 10.2V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 12V	ac20	5260	Ant1	5260	0	0	25	Pass
20C 13.8V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 12V	ac20	5260	Ant1	5260	0	0	25	Pass
-10C 12V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 12V	ac20	5260	Ant1	5260	0	0	25	Pass
10C 12V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
30C 12V	ac20	5260	Ant1	5260.02	20000	3.8	25	Pass
40C 12V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
50C 12V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 10.2V	ac20	5280	Ant1	5280	0	0	25	Pass
20C 12V	ac20	5280	Ant1	5280	0	0	25	Pass
20C 13.8V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-20C 12V	ac20	5280	Ant1	5280.02	20000	3.79	25	Pass

-10C 12V	ac20	5280	Ant1	5280.02	20000	3.79	25	Pass
0C 12V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
10C 12V	ac20	5280	Ant1	5280	0	0	25	Pass
30C 12V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 12V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
50C 12V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 10.2V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 12V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 13.8V	ac20	5320	Ant1	5320	0	0	25	Pass
-20C 12V	ac20	5320	Ant1	5320	0	0	25	Pass
-10C 12V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
0C 12V	ac20	5320	Ant1	5320	0	0	25	Pass
10C 12V	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
30C 12V	ac20	5320	Ant1	5320	0	0	25	Pass
40C 12V	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
50C 12V	ac20	5320	Ant1	5320	0	0	25	Pass
20C 10.2V	ac20	5500	Ant1	5500	0	0	25	Pass
20C 12V	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 13.8V	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-20C 12V	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
-10C 12V	ac20	5500	Ant1	5500	0	0	25	Pass
0C 12V	ac20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
10C 12V	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
30C 12V	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
40C 12V	ac20	5500	Ant1	5500	0	0	25	Pass
50C 12V	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 10.2V	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
20C 12V	ac20	5580	Ant1	5580	0	0	25	Pass
20C 13.8V	ac20	5580	Ant1	5580	0	0	25	Pass
-20C 12V	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
-10C 12V	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
0C 12V	ac20	5580	Ant1	5580	0	0	25	Pass
10C 12V	ac20	5580	Ant1	5580	0	0	25	Pass
30C 12V	ac20	5580	Ant1	5580.02	20000	3.58	25	Pass
40C 12V	ac20	5580	Ant1	5580	0	0	25	Pass
50C 12V	ac20	5580	Ant1	5580	0	0	25	Pass
20C 10.2V	ac20	5700	Ant1	5700	0	0	25	Pass
20C 12V	ac20	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 13.8V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-20C 12V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
-10C 12V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass

0C 12V	ac20	5700	Ant1	5700	0	0	25	Pass
10C 12V	ac20	5700	Ant1	5700	0	0	25	Pass
30C 12V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
40C 12V	ac20	5700	Ant1	5700	0	0	25	Pass
50C 12V	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
20C 10.2V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 12V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 13.8V	ac20	5745	Ant1	5745	0	0	25	Pass
-20C 12V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
-10C 12V	ac20	5745	Ant1	5745	0	0	25	Pass
0C 12V	ac20	5745	Ant1	5745	0	0	25	Pass
10C 12V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
30C 12V	ac20	5745	Ant1	5745	0	0	25	Pass
40C 12V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
50C 12V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 10.2V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
20C 12V	ac20	5825	Ant1	5825	0	0	25	Pass
20C 13.8V	ac20	5825	Ant1	5824.96	-40000	-6.87	25	Pass
-20C 12V	ac20	5825	Ant1	5825	0	0	25	Pass
-10C 12V	ac20	5825	Ant1	5825	0	0	25	Pass
0C 12V	ac20	5825	Ant1	5825	0	0	25	Pass
10C 12V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
30C 12V	ac20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
40C 12V	ac20	5825	Ant1	5825	0	0	25	Pass
50C 12V	ac20	5825	Ant1	5825	0	0	25	Pass
20C 10.2V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 12V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 13.8V	ac40	5190	Ant1	5189.92	-80000	-15.41	25	Pass
-20C 12V	ac40	5190	Ant1	5190	0	0	25	Pass
-10C 12V	ac40	5190	Ant1	5190	0	0	25	Pass
0C 12V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
10C 12V	ac40	5190	Ant1	5189.88	-120000	-23.12	25	Pass
30C 12V	ac40	5190	Ant1	5190	0	0	25	Pass
40C 12V	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
50C 12V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 10.2V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 12V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 13.8V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
-20C 12V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
-10C 12V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
0C 12V	ac40	5230	Ant1	5230	0	0	25	Pass


10C 12V	ac40	5230	Ant1	5230	0	0	25	Pass
30C 12V	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
40C 12V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
50C 12V	ac40	5230	Ant1	5230	0	0	25	Pass
20C 10.2V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
20C 12V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
20C 13.8V	ac40	5270	Ant1	5270	0	0	25	Pass
-20C 12V	ac40	5270	Ant1	5270	0	0	25	Pass
-10C 12V	ac40	5270	Ant1	5270	0	0	25	Pass
0C 12V	ac40	5270	Ant1	5270	0	0	25	Pass
10C 12V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
30C 12V	ac40	5270	Ant1	5270	0	0	25	Pass
40C 12V	ac40	5270	Ant1	5270	0	0	25	Pass
50C 12V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
20C 10.2V	ac40	5310	Ant1	5310	0	0	25	Pass
20C 12V	ac40	5310	Ant1	5310.04	40000	7.53	25	Pass
20C 13.8V	ac40	5310	Ant1	5310	0	0	25	Pass
-20C 12V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
-10C 12V	ac40	5310	Ant1	5310	0	0	25	Pass
0C 12V	ac40	5310	Ant1	5310	0	0	25	Pass
10C 12V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
30C 12V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
40C 12V	ac40	5310	Ant1	5310	0	0	25	Pass
50C 12V	ac40	5310	Ant1	5310	0	0	25	Pass
20C 10.2V	ac40	5510	Ant1	5510	0	0	25	Pass
20C 12V	ac40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
20C 13.8V	ac40	5510	Ant1	5510	0	0	25	Pass
-20C 12V	ac40	5510	Ant1	5510.12	120000	21.78	25	Pass
-10C 12V	ac40	5510	Ant1	5510	0	0	25	Pass
0C 12V	ac40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
10C 12V	ac40	5510	Ant1	5510	0	0	25	Pass
30C 12V	ac40	5510	Ant1	5510	0	0	25	Pass
40C 12V	ac40	5510	Ant1	5510	0	0	25	Pass
50C 12V	ac40	5510	Ant1	5510	0	0	25	Pass
20C 10.2V	ac40	5550	Ant1	5550	0	0	25	Pass
20C 12V	ac40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
20C 13.8V	ac40	5550	Ant1	5550.04	40000	7.21	25	Pass
-20C 12V	ac40	5550	Ant1	5550	0	0	25	Pass
-10C 12V	ac40	5550	Ant1	5550	0	0	25	Pass
0C 12V	ac40	5550	Ant1	5549.96	-40000	-7.21	25	Pass
10C 12V	ac40	5550	Ant1	5550	0	0	25	Pass


30C 12V	ac40	5550	Ant1	5550	0	0	25	Pass
40C 12V	ac40	5550	Ant1	5550	0	0	25	Pass
50C 12V	ac40	5550	Ant1	5550	0	0	25	Pass
20C 10.2V	ac40	5670	Ant1	5670	0	0	25	Pass
20C 12V	ac40	5670	Ant1	5670.04	40000	7.05	25	Pass
20C 13.8V	ac40	5670	Ant1	5670	0	0	25	Pass
-20C 12V	ac40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
-10C 12V	ac40	5670	Ant1	5670	0	0	25	Pass
0C 12V	ac40	5670	Ant1	5670	0	0	25	Pass
10C 12V	ac40	5670	Ant1	5670	0	0	25	Pass
30C 12V	ac40	5670	Ant1	5670	0	0	25	Pass
40C 12V	ac40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
50C 12V	ac40	5670	Ant1	5670	0	0	25	Pass
20C 10.2V	ac40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 12V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
20C 13.8V	ac40	5755	Ant1	5755	0	0	25	Pass
-20C 12V	ac40	5755	Ant1	5754.96	-40000	-6.95	25	Pass
-10C 12V	ac40	5755	Ant1	5755	0	0	25	Pass
0C 12V	ac40	5755	Ant1	5755	0	0	25	Pass
10C 12V	ac40	5755	Ant1	5755	0	0	25	Pass
30C 12V	ac40	5755	Ant1	5755	0	0	25	Pass
40C 12V	ac40	5755	Ant1	5755	0	0	25	Pass
50C 12V	ac40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 10.2V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 12V	ac40	5795	Ant1	5795	0	0	25	Pass
20C 13.8V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
-20C 12V	ac40	5795	Ant1	5795	0	0	25	Pass
-10C 12V	ac40	5795	Ant1	5795	0	0	25	Pass
0C 12V	ac40	5795	Ant1	5795	0	0	25	Pass
10C 12V	ac40	5795	Ant1	5795	0	0	25	Pass
30C 12V	ac40	5795	Ant1	5795	0	0	25	Pass
40C 12V	ac40	5795	Ant1	5795	0	0	25	Pass
50C 12V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 10.2V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 12V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 13.8V	ac80	5210	Ant1	5210	0	0	25	Pass
-20C 12V	ac80	5210	Ant1	5210	0	0	25	Pass
-10C 12V	ac80	5210	Ant1	5210	0	0	25	Pass
0C 12V	ac80	5210	Ant1	5210	0	0	25	Pass
10C 12V	ac80	5210	Ant1	5210	0	0	25	Pass
30C 12V	ac80	5210	Ant1	5210	0	0	25	Pass

40C 12V	ac80	5210	Ant1	5210	0	0	25	Pass
50C 12V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 10.2V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 12V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 13.8V	ac80	5290	Ant1	5290	0	0	25	Pass
-20C 12V	ac80	5290	Ant1	5290	0	0	25	Pass
-10C 12V	ac80	5290	Ant1	5290	0	0	25	Pass
0C 12V	ac80	5290	Ant1	5290	0	0	25	Pass
10C 12V	ac80	5290	Ant1	5290	0	0	25	Pass
30C 12V	ac80	5290	Ant1	5290	0	0	25	Pass
40C 12V	ac80	5290	Ant1	5290	0	0	25	Pass
50C 12V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 10.2V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 12V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 13.8V	ac80	5530	Ant1	5530	0	0	25	Pass
-20C 12V	ac80	5530	Ant1	5530	0	0	25	Pass
-10C 12V	ac80	5530	Ant1	5530	0	0	25	Pass
0C 12V	ac80	5530	Ant1	5530	0	0	25	Pass
10C 12V	ac80	5530	Ant1	5530	0	0	25	Pass
30C 12V	ac80	5530	Ant1	5530	0	0	25	Pass
40C 12V	ac80	5530	Ant1	5530	0	0	25	Pass
50C 12V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 10.2V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 12V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 13.8V	ac80	5775	Ant1	5775	0	0	25	Pass
-20C 12V	ac80	5775	Ant1	5775	0	0	25	Pass
-10C 12V	ac80	5775	Ant1	5775	0	0	25	Pass
0C 12V	ac80	5775	Ant1	5775	0	0	25	Pass
10C 12V	ac80	5775	Ant1	5775	0	0	25	Pass
30C 12V	ac80	5775	Ant1	5775	0	0	25	Pass
40C 12V	ac80	5775	Ant1	5775	0	0	25	Pass
50C 12V	ac80	5775	Ant1	5775	0	0	25	Pass


-6dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-6 dB Bandwidth (MHz)	Limit -6 dB Bandwidth (MHz)	Verdict
NVNT	a	5745	Ant1	16.284	0.5	Pass
NVNT	a	5785	Ant1	16.269	0.5	Pass
NVNT	a	5825	Ant1	16.032	0.5	Pass
NVNT	n20	5745	Ant1	17.532	0.5	Pass
NVNT	n20	5785	Ant1	17.292	0.5	Pass
NVNT	n20	5825	Ant1	17.271	0.5	Pass
NVNT	n40	5755	Ant1	35.64	0.5	Pass
NVNT	n40	5795	Ant1	35.97	0.5	Pass
NVNT	ac20	5745	Ant1	17.55	0.5	Pass
NVNT	ac20	5785	Ant1	17.268	0.5	Pass
NVNT	ac20	5825	Ant1	17.55	0.5	Pass
NVNT	ac40	5755	Ant1	35.652	0.5	Pass
NVNT	ac40	5795	Ant1	35.64	0.5	Pass
NVNT	ac80	5775	Ant1	76.38	0.5	Pass

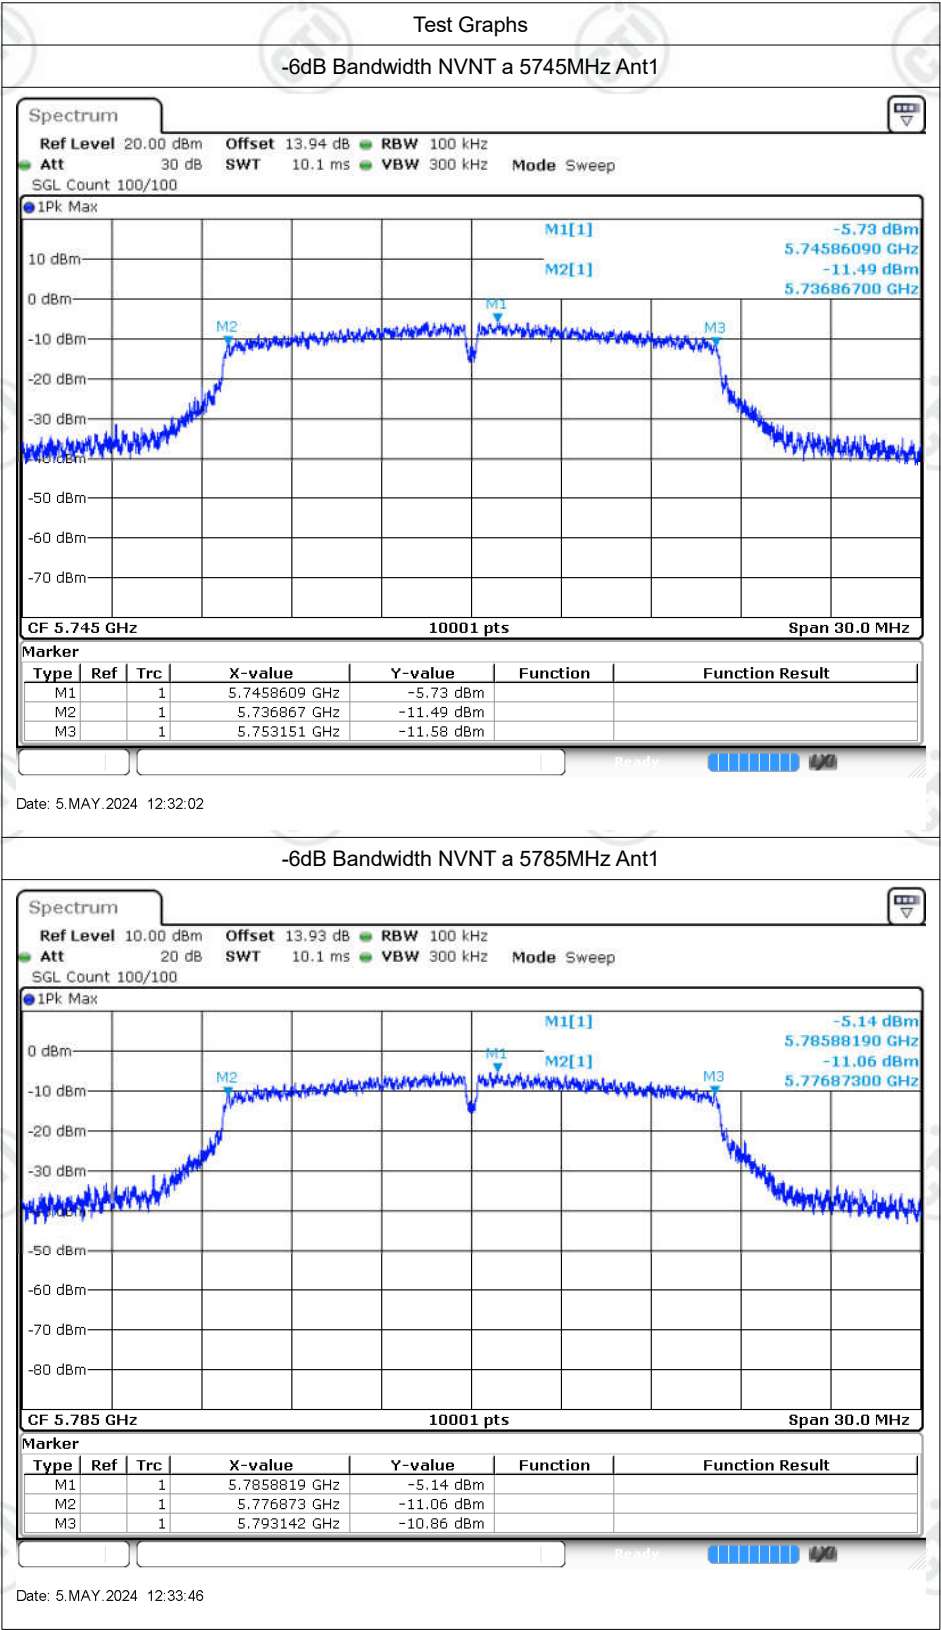


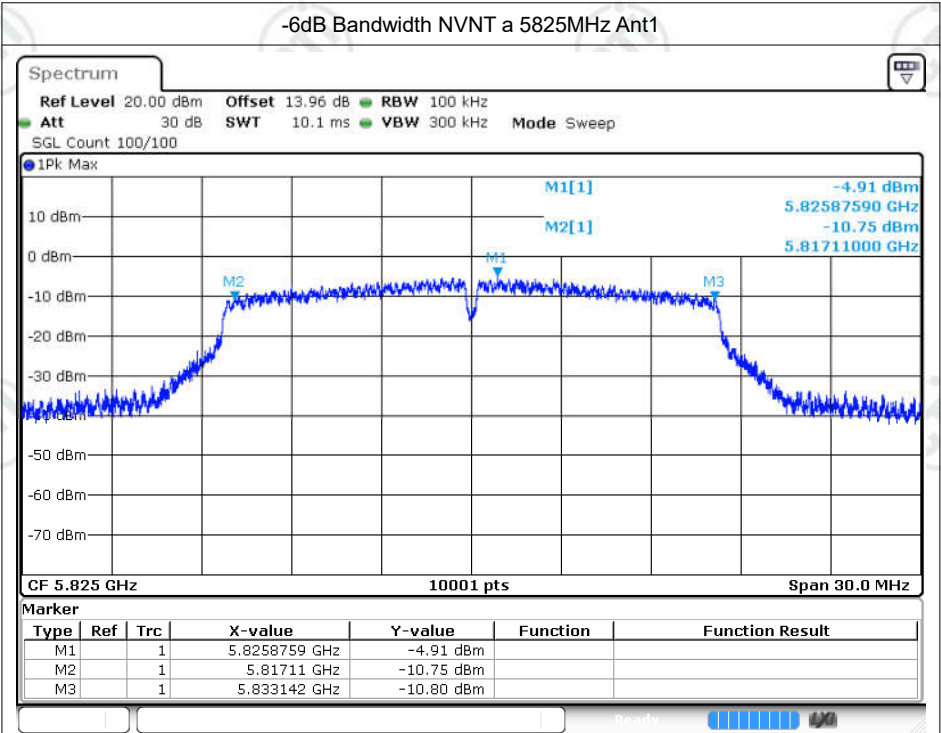


Date: 5.MAY.2024 12:34:41

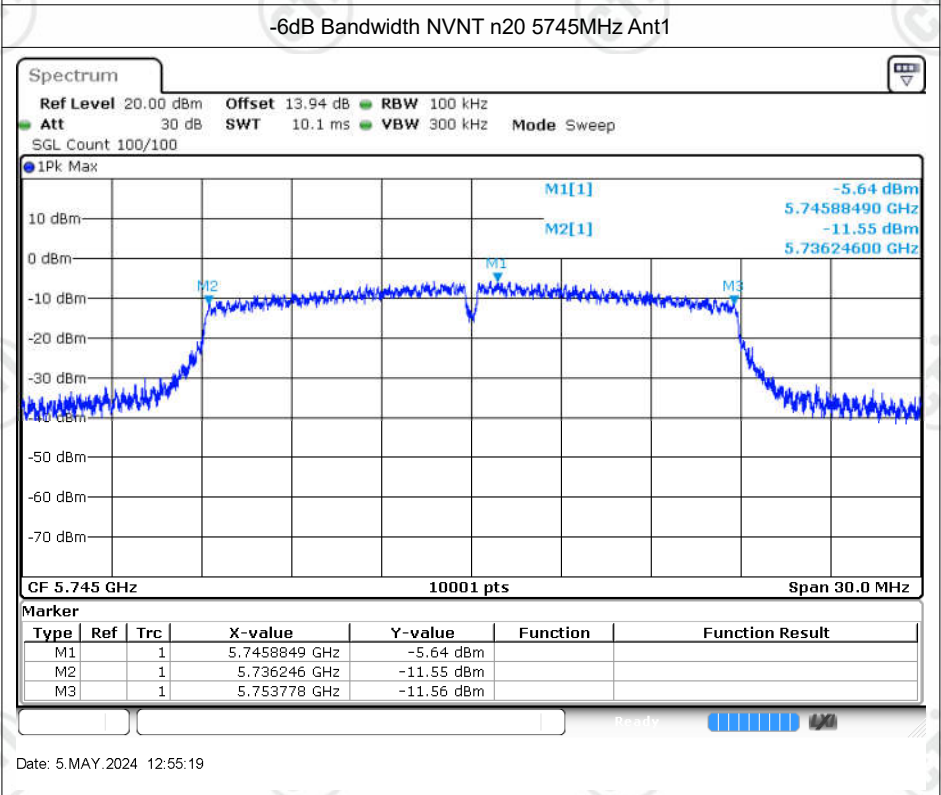


Date: 5.MAY.2024 12:55:19

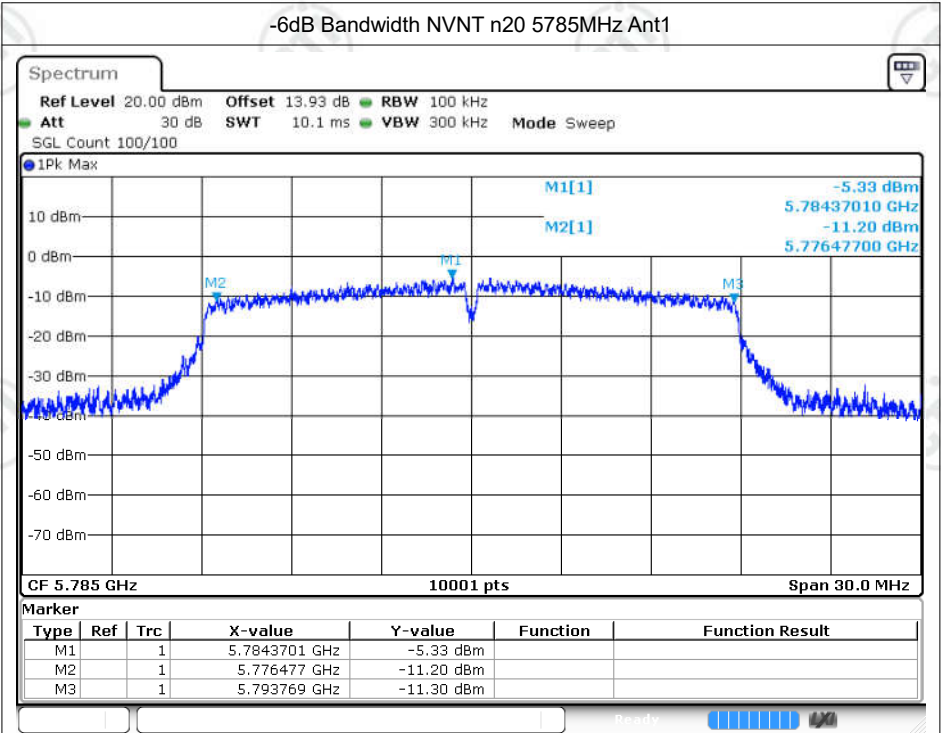


Date: 5.MAY.2024 12:56:51

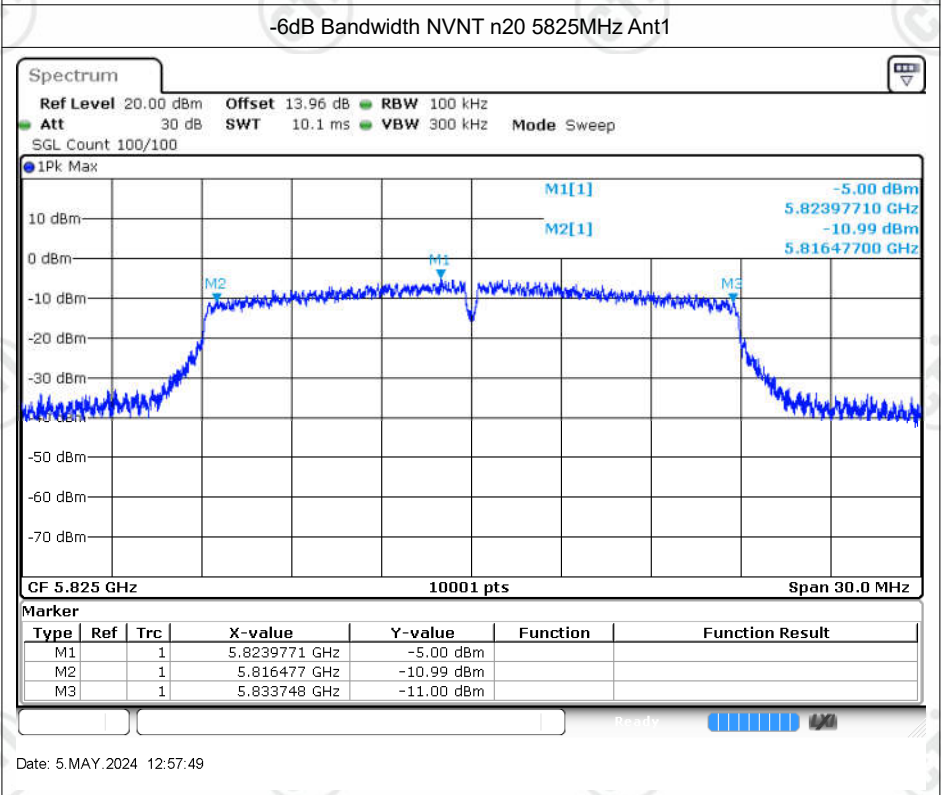


Date: 5.MAY.2024 12:57:49

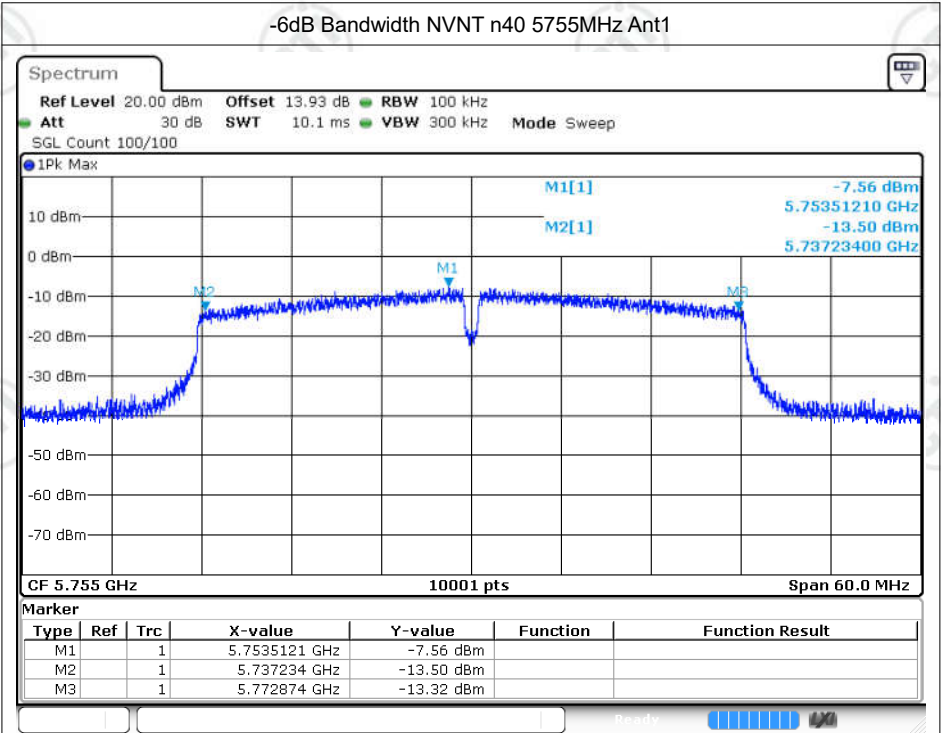


Date: 5.MAY.2024 13:14:53

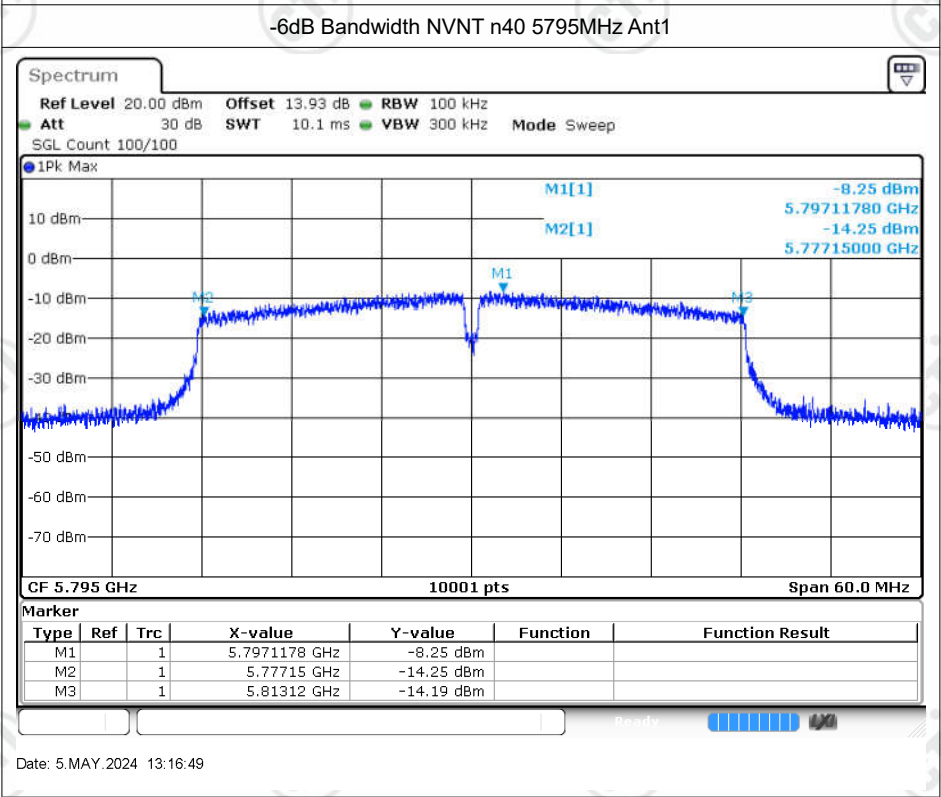


Date: 5.MAY.2024 13:16:49

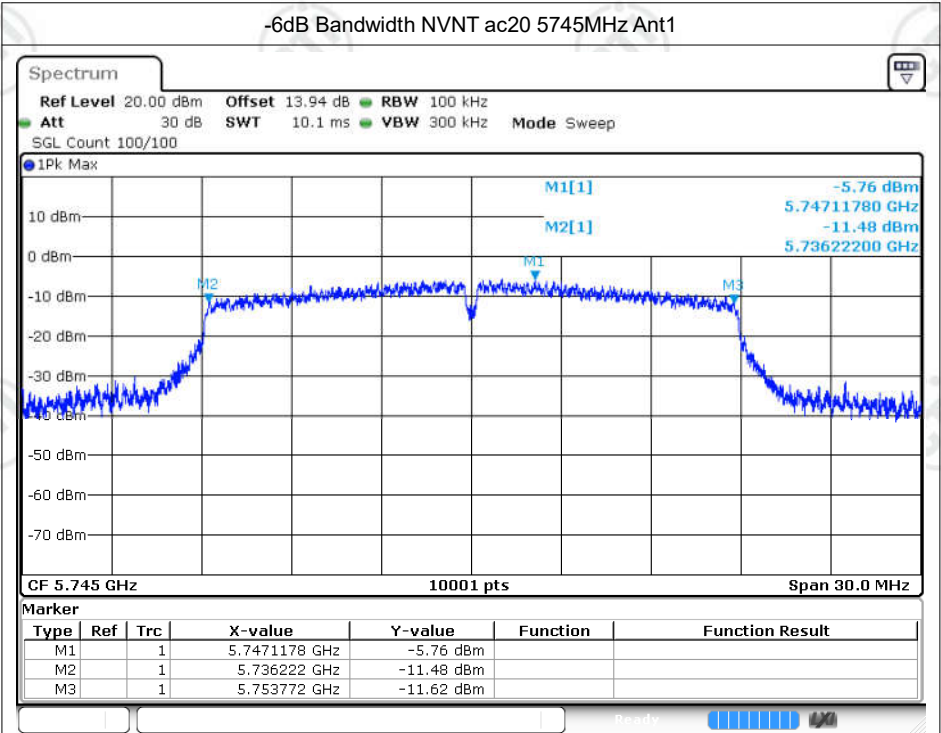


Date: 5.MAY.2024 13:35:52

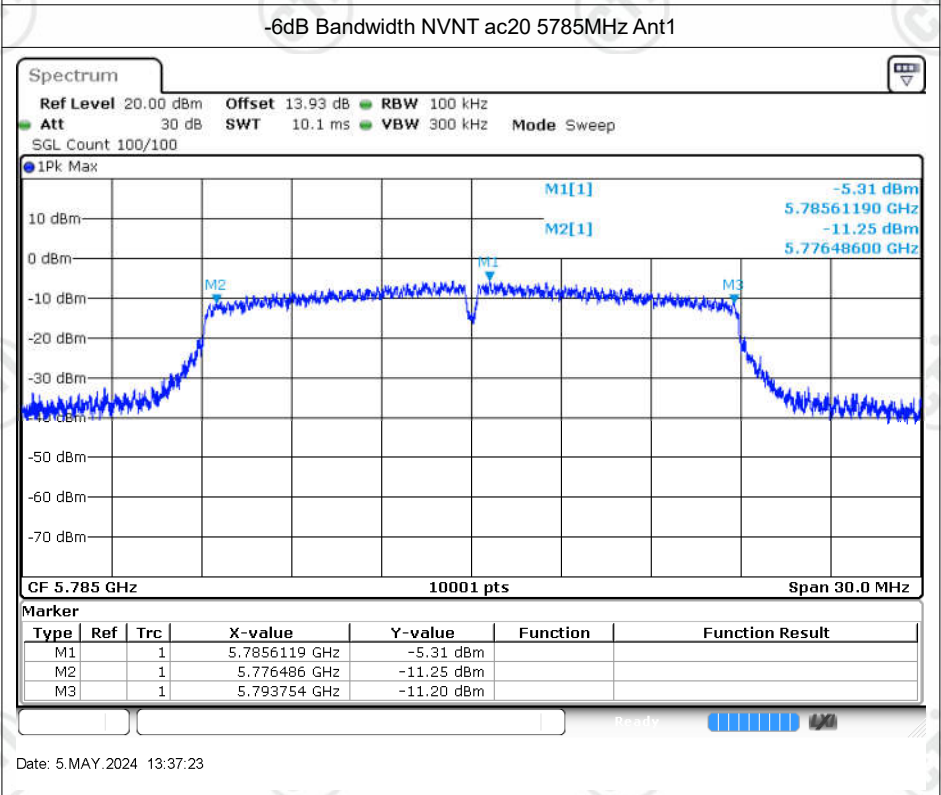


Date: 5.MAY.2024 13:37:23

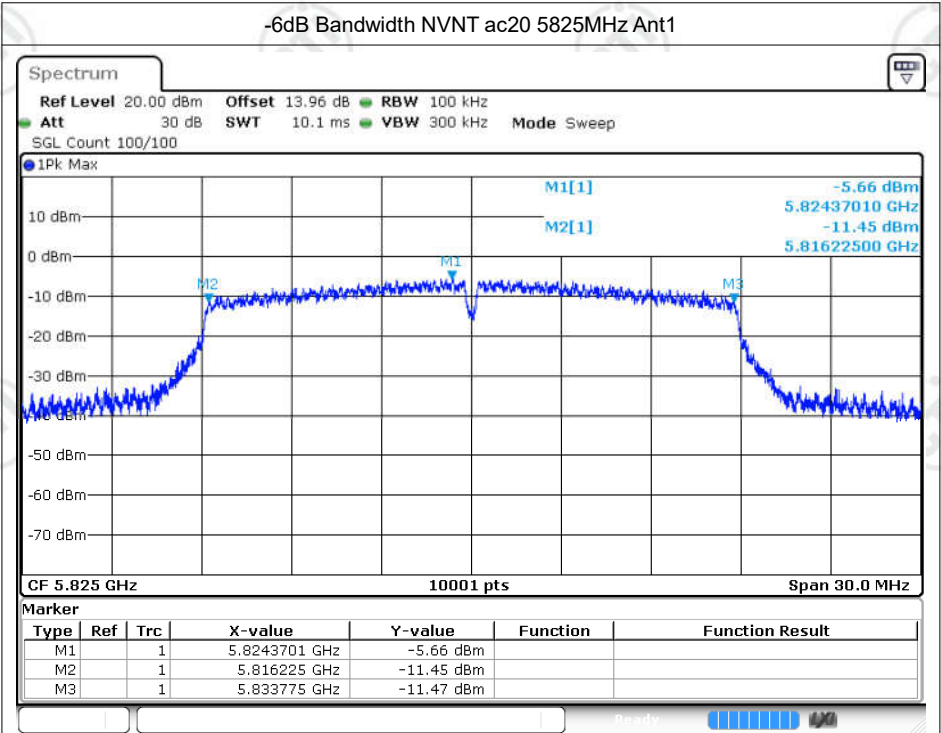


Date: 5.MAY.2024 13:38:12

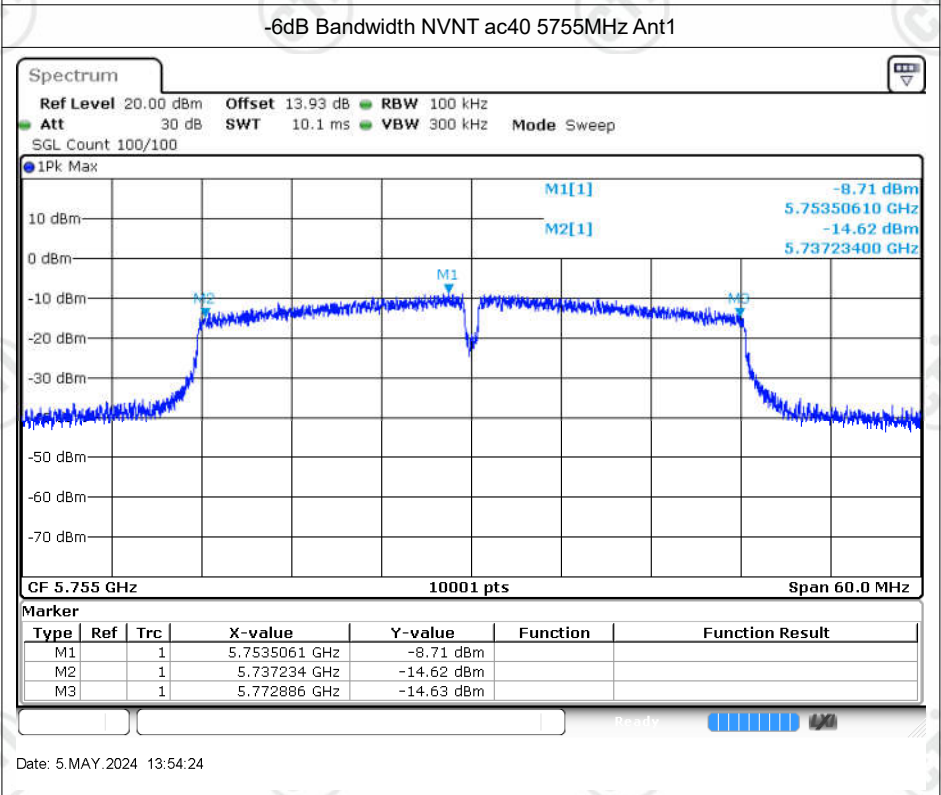

Date: 5.MAY.2024 13:54:24

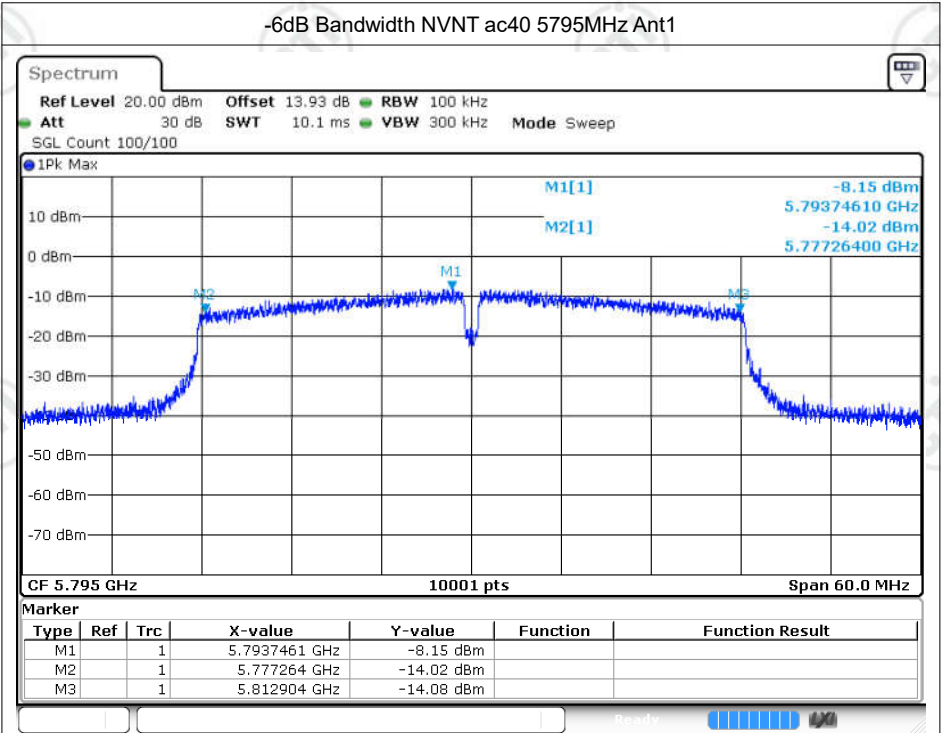

Date: 5.MAY.2024 13:56:06

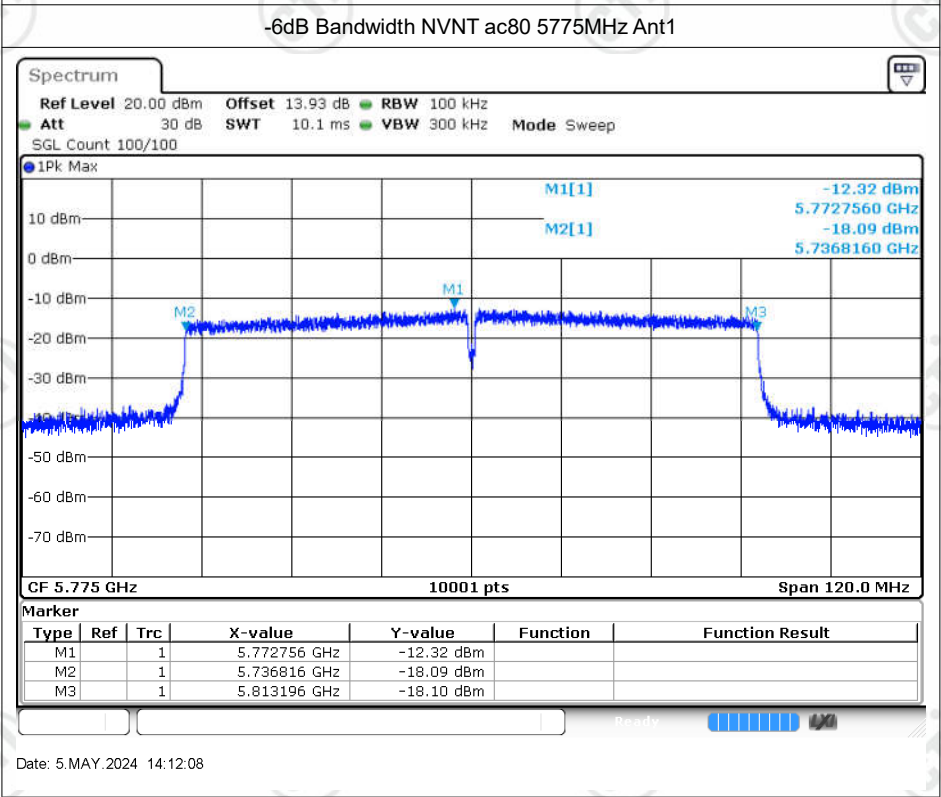

Date: 5.MAY.2024 14:12:08

*** End of Report ***