






3DH5_Ant1_2402

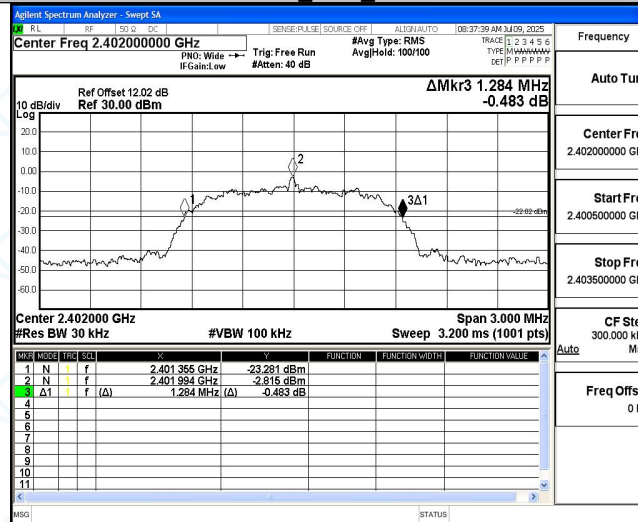

3DH5_Ant1_2441

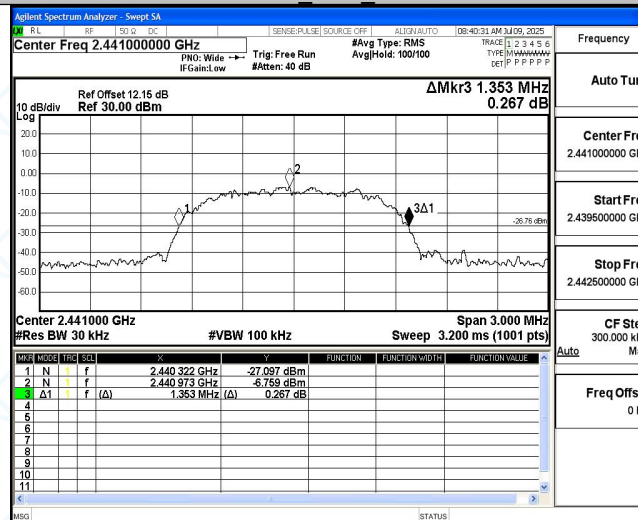

3DH5_Ant1_2480

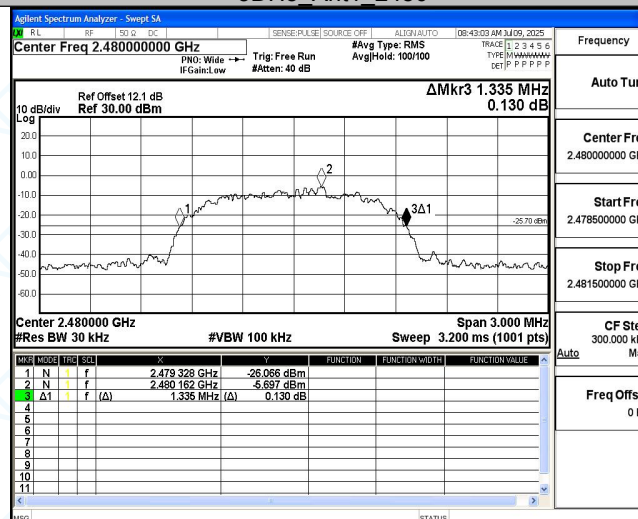

**Appendix B: Maximum conducted output power****Test Result(Left earphone)**

Test Mode	Antenna	Freq(MHz)	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	2.63	≤20.97	PASS
		2441	3.15	≤20.97	PASS
		2480	2.44	≤20.97	PASS
2DH5	Ant1	2402	1.16	≤20.97	PASS
		2441	1.65	≤20.97	PASS
		2480	0.89	≤20.97	PASS
3DH5	Ant1	2402	1.37	≤20.97	PASS
		2441	2.01	≤20.97	PASS
		2480	1.29	≤20.97	PASS


Test Result(Right earphone)

Test Mode	Antenna	Freq(MHz)	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	2.91	≤20.97	PASS
		2441	3.22	≤20.97	PASS
		2480	2.72	≤20.97	PASS
2DH5	Ant1	2402	1.22	≤20.97	PASS
		2441	1.57	≤20.97	PASS
		2480	1.10	≤20.97	PASS
3DH5	Ant1	2402	1.72	≤20.97	PASS
		2441	2.01	≤20.97	PASS
		2480	1.50	≤20.97	PASS




Test Graphs(Left earphone)


DH5_Ant1_2402

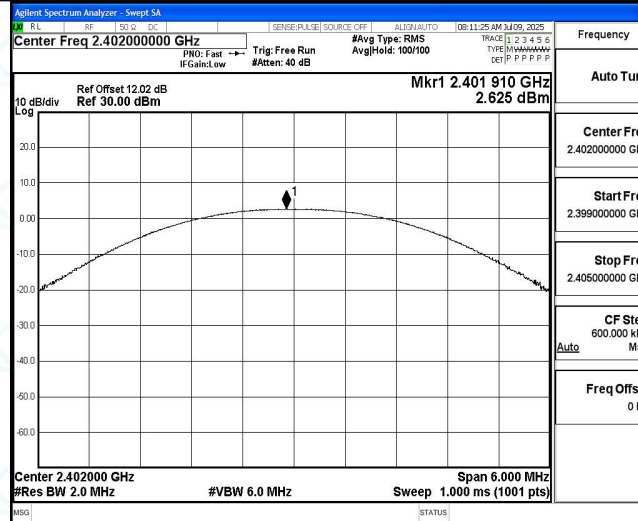

DH5_Ant1_2441

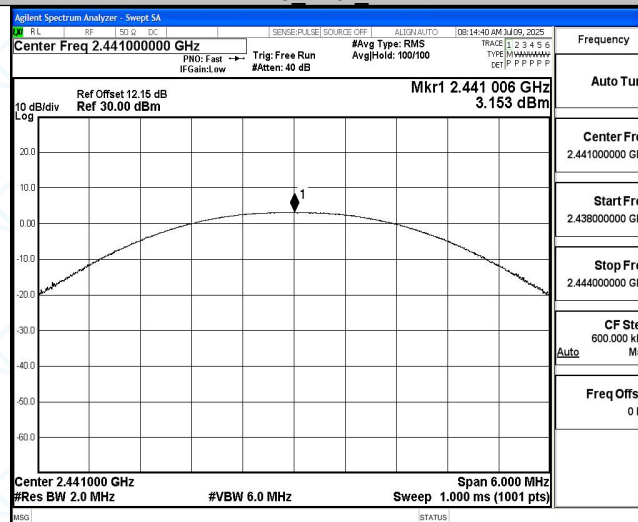


DH5_Ant1_2480

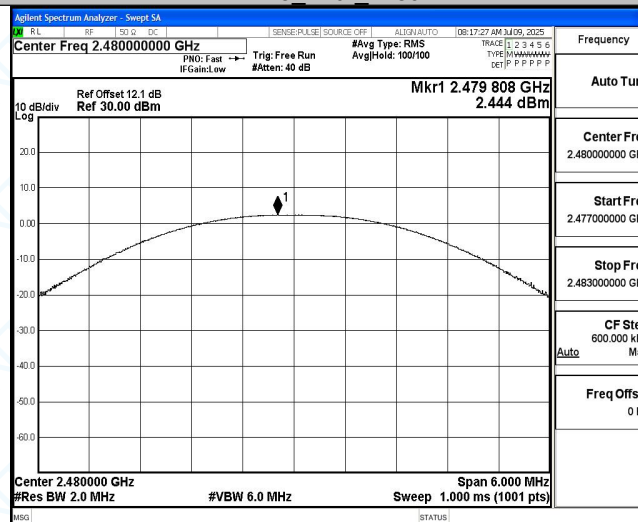





2DH5_Ant1_2402

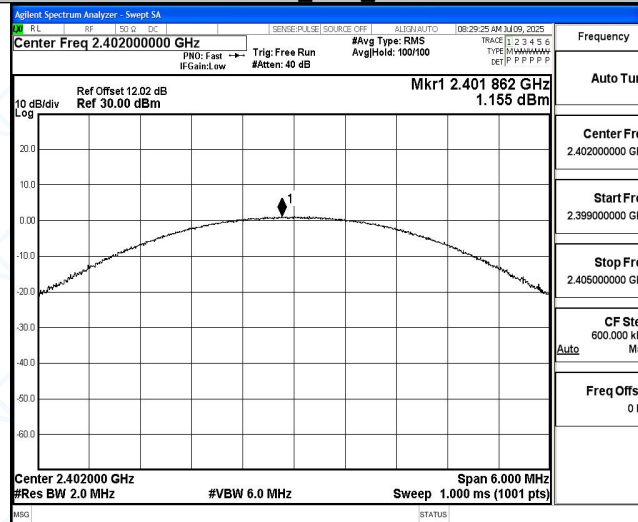

2DH5_Ant1_2441

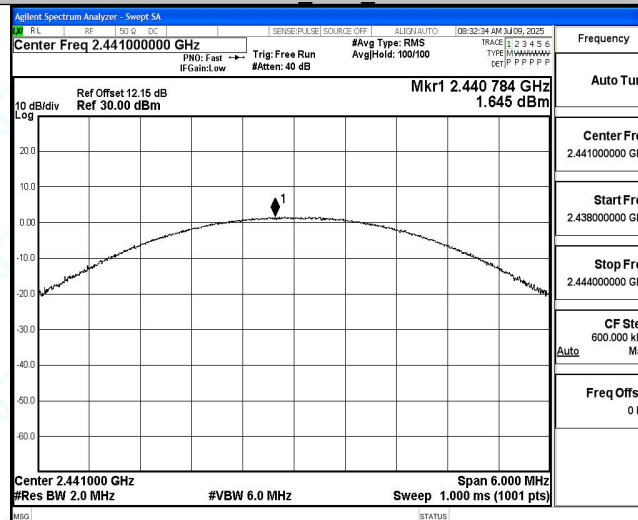


2DH5_Ant1_2480

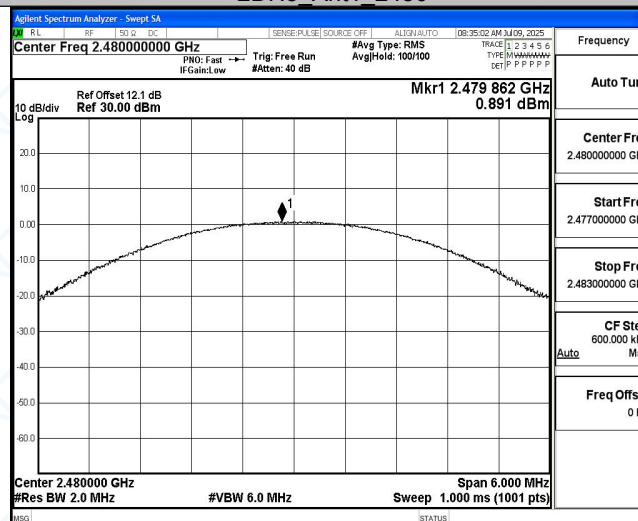





3DH5_Ant1_2402

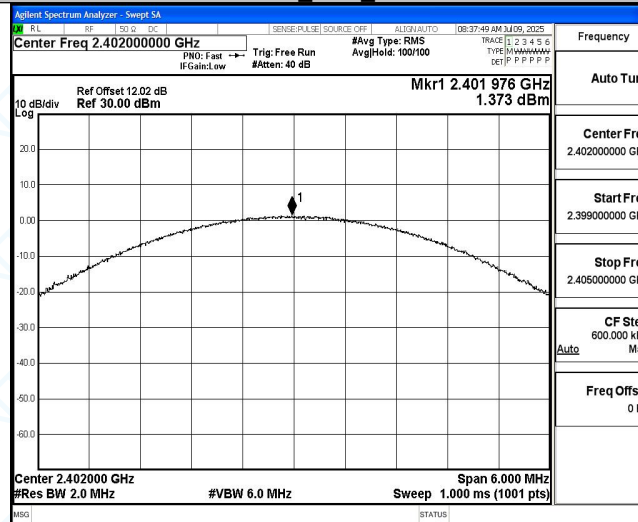

3DH5_Ant1_2441

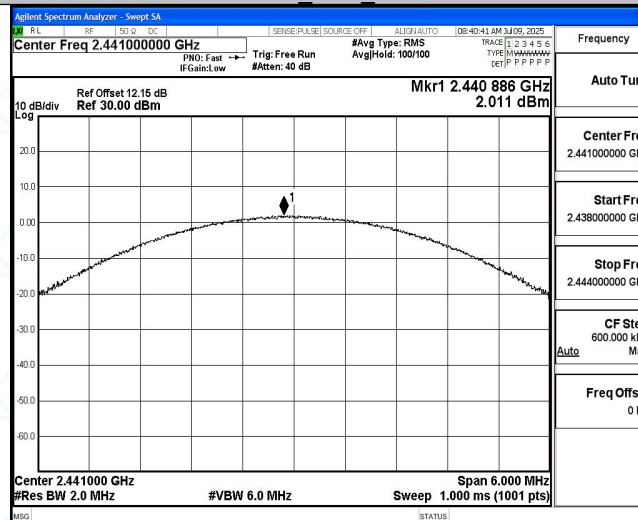


3DH5_Ant1_2480

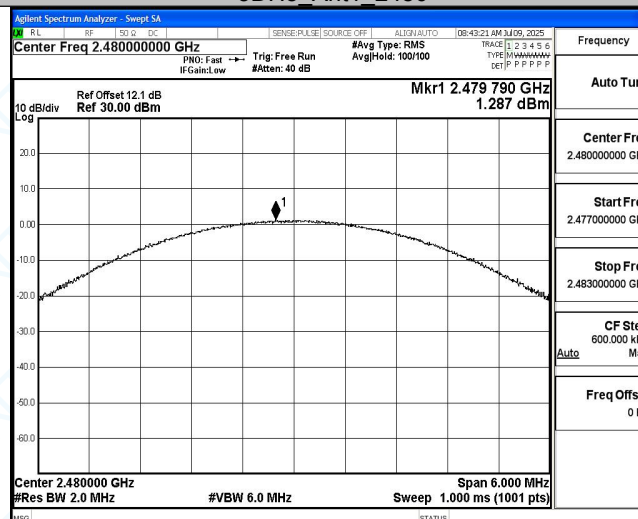




Test Graphs(Right earphone)


DH5_Ant1_2402

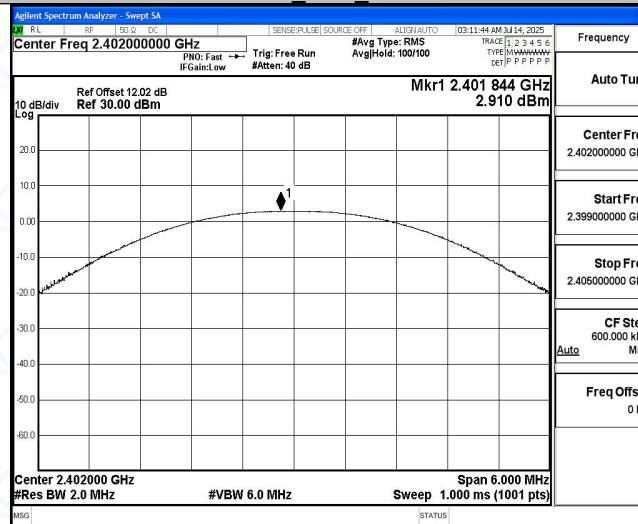


DH5_Ant1_2441

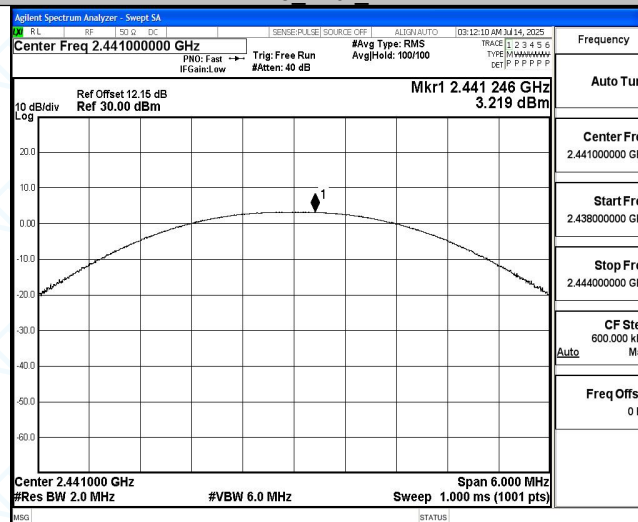


DH5_Ant1_2480

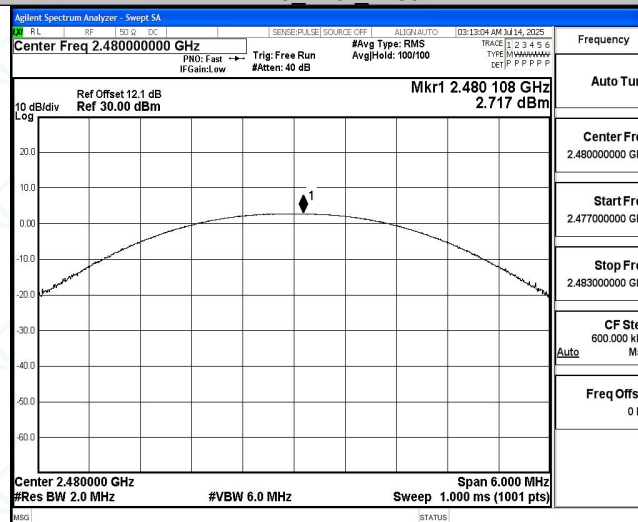


2DH5_Ant1_2402

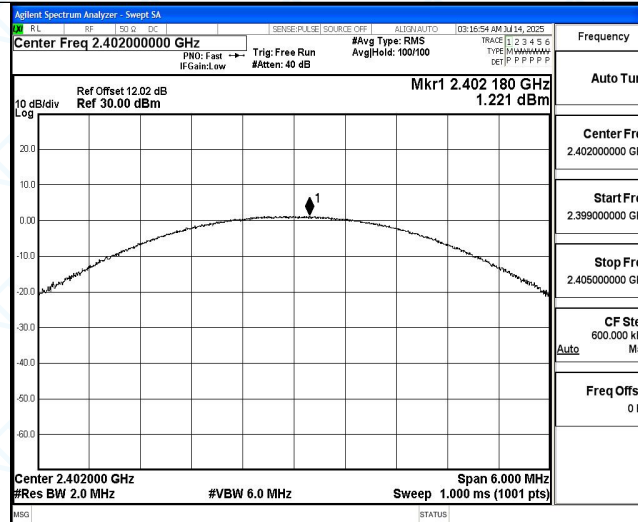


2DH5_Ant1_2441

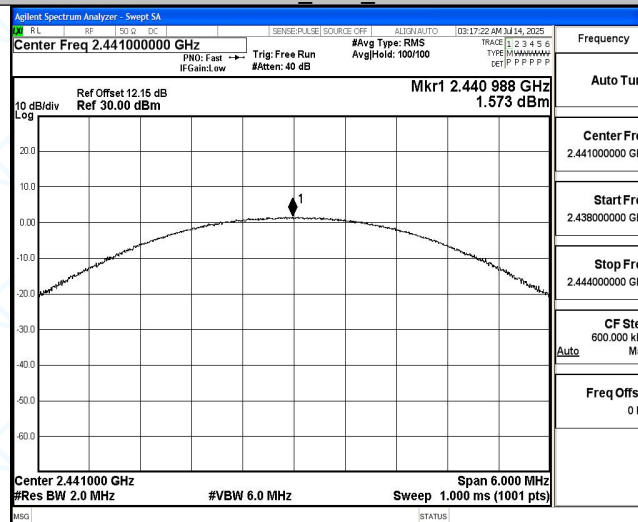


2DH5_Ant1_2480

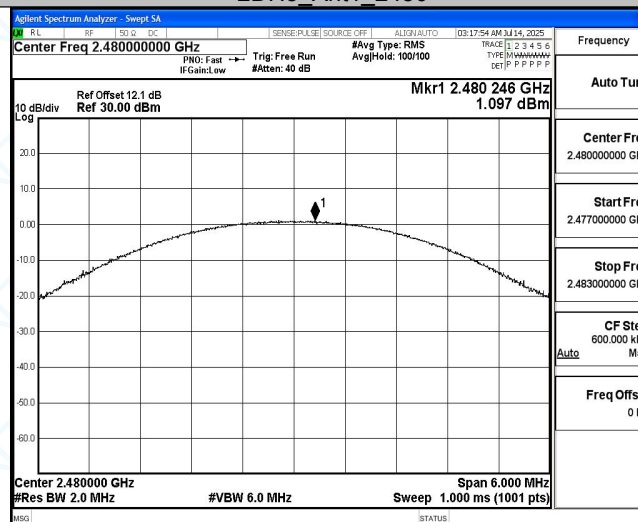


3DH5_Ant1_2402

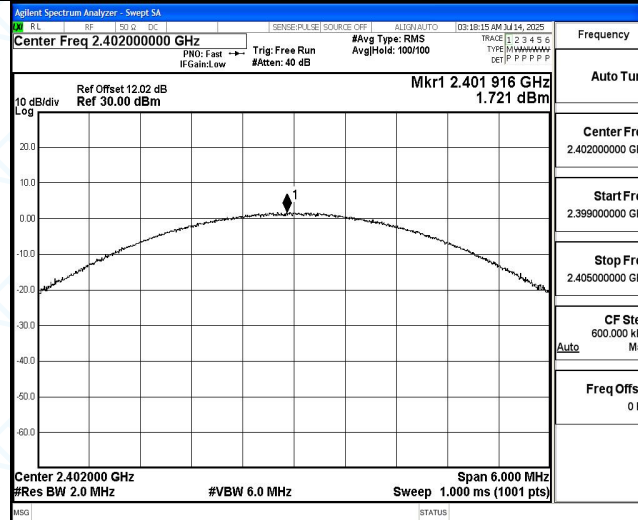

3DH5_Ant1_2441

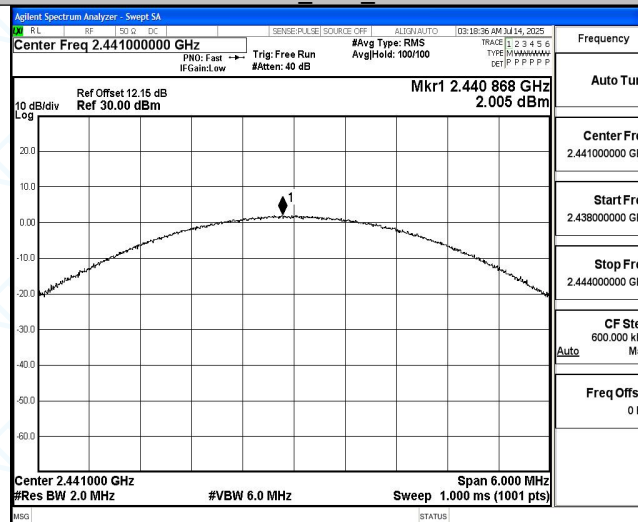

3DH5_Ant1_2480

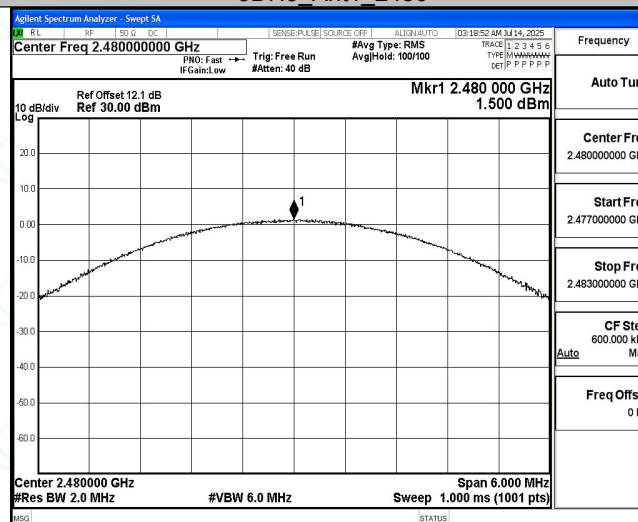



Appendix C: Carrier frequency separation

Test Result


TestMode	Antenna	Freq(MHz)	Result[MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	0.986	≥0.670	PASS
2DH5	Ant1	Hop	1.014	≥0.910	PASS
3DH5	Ant1	Hop	0.96	≥0.902	PASS

Note:
Both left and right earphone have tested, The Right earphone is the worst and only the worse case was reported.




Test Graphs


DH5_Ant1_Hop

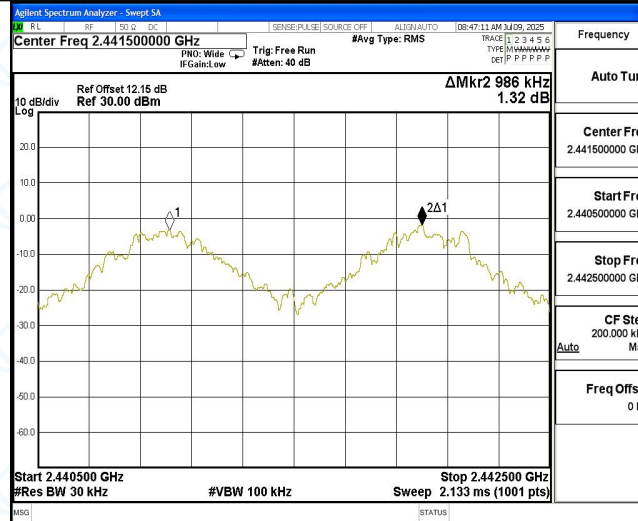

2DH5_Ant1_Hop

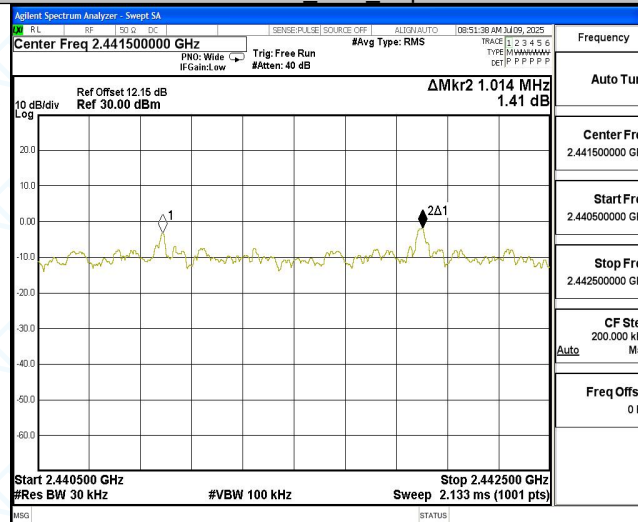

3DH5_Ant1_Hop

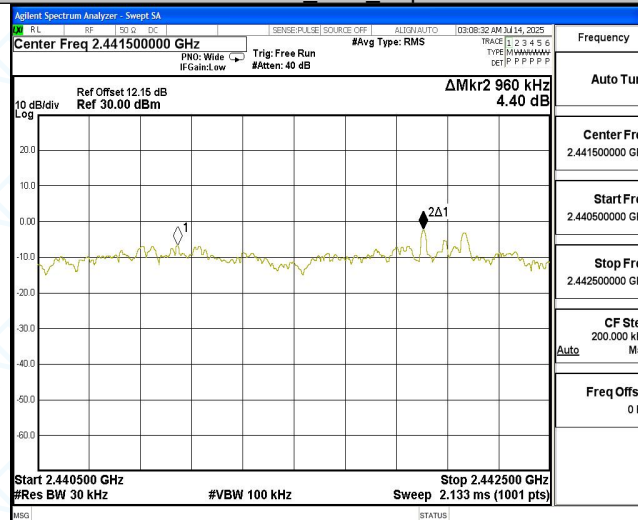



Appendix D: Dwell Time

Test Result


TestMode	Antenna	Freq(MHz)	BurstWidth [ms]	TotalHops [Num]	Result[s]	Limit[s]	Verdict
DH1	Ant1	Hop	0.376	320	0.12	≤0.4	PASS
DH3	Ant1	Hop	1.633	160	0.261	≤0.4	PASS
DH5	Ant1	Hop	2.880	106.67	0.307	≤0.4	PASS
2DH1	Ant1	Hop	0.386	320	0.124	≤0.4	PASS
2DH3	Ant1	Hop	1.638	160	0.262	≤0.4	PASS
2DH5	Ant1	Hop	2.887	106.67	0.308	≤0.4	PASS
3DH1	Ant1	Hop	0.385	320	0.123	≤0.4	PASS
3DH3	Ant1	Hop	1.637	160	0.262	≤0.4	PASS
3DH5	Ant1	Hop	2.887	106.67	0.308	≤0.4	PASS

Note:


Both left and right earphone have tested, The Right earphone is the worst and only the worse case was reported.

Test Graphs


DH1 Ant1 Hop

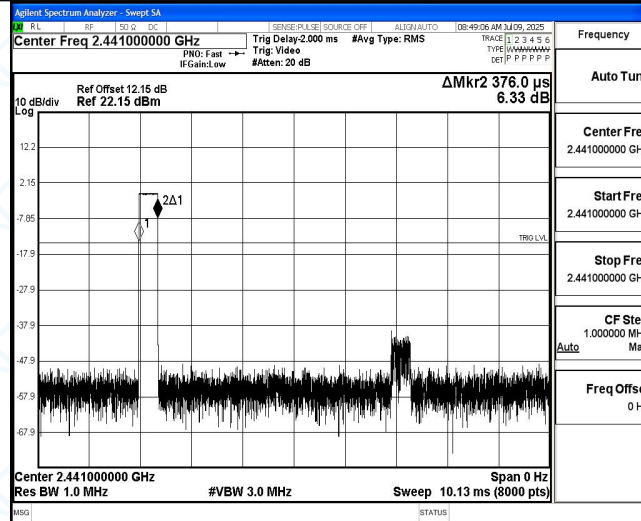

DH3_Ant1_Hop

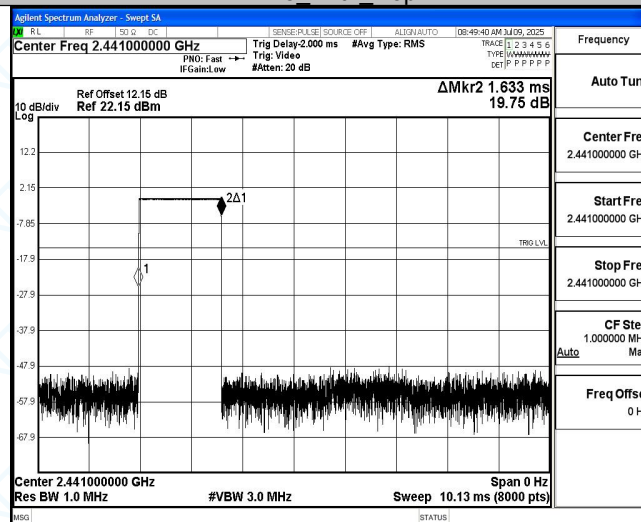


DH5_Ant1_Hop

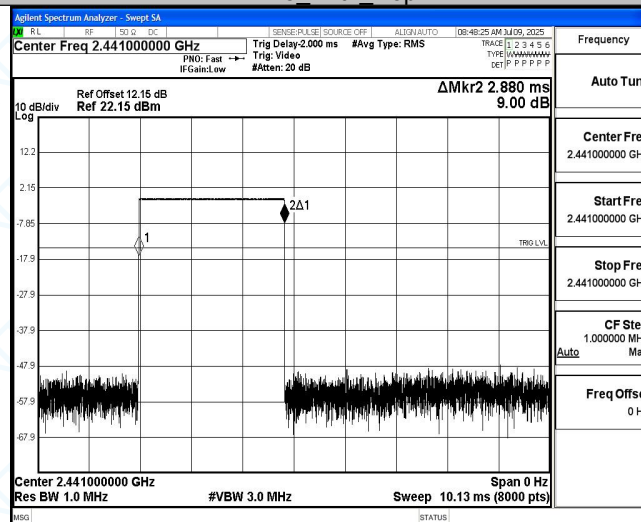




2DH1 Ant1 Hop

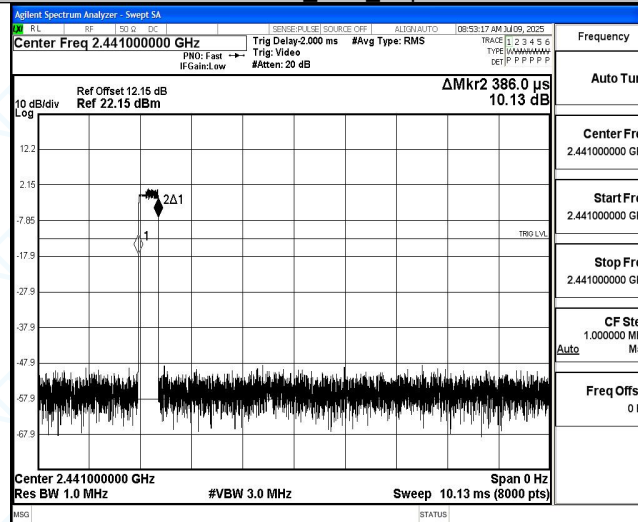

2DH3 Ant1 Hop

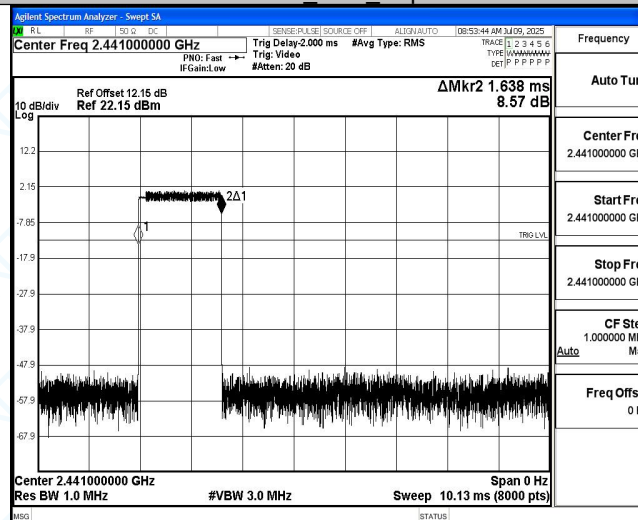

2DH5 Ant1 Hop

