



Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-35.46	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-68.20	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-60.87	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-62.19	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-33.28	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-35.18	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-66.45	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-61.55	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-62.35	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-33.35	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.27	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-65.62	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-59.38	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-62.20	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-32.93	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.16	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-68.96	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-60.90	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-62.21	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-33.43	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-35.52	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-66.61	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-62.71	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-62.37	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-33.01	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-35.25	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-65.62	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-62.15	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-61.77	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-32.92	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-35.24	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-66.69	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-62.05	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-62.12	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-33.28	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-35.50	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-68.19	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-61.77	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-62.37	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-32.93	PASS






Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-35.33	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-66.73	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-59.29	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-62.05	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-33.28	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-34.96	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-69.32	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-62.51	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-61.84	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-33.05	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.40	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-67.71	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-60.05	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-62.36	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-33.38	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-35.10	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-67.78	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-60.08	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-62.00	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-33.14	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.33	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-68.13	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-59.56	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-62.52	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-33.49	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-35.60	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-63.74	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-61.76	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-62.23	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-33.68	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-35.52	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-66.88	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-62.50	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-62.17	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-33.09	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-35.46	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-68.23	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-58.90	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-62.20	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-33.09	PASS






Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-35.53	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-67.26	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-60.23	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-62.07	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-33.30	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-35.34	PASS

Test Graphs

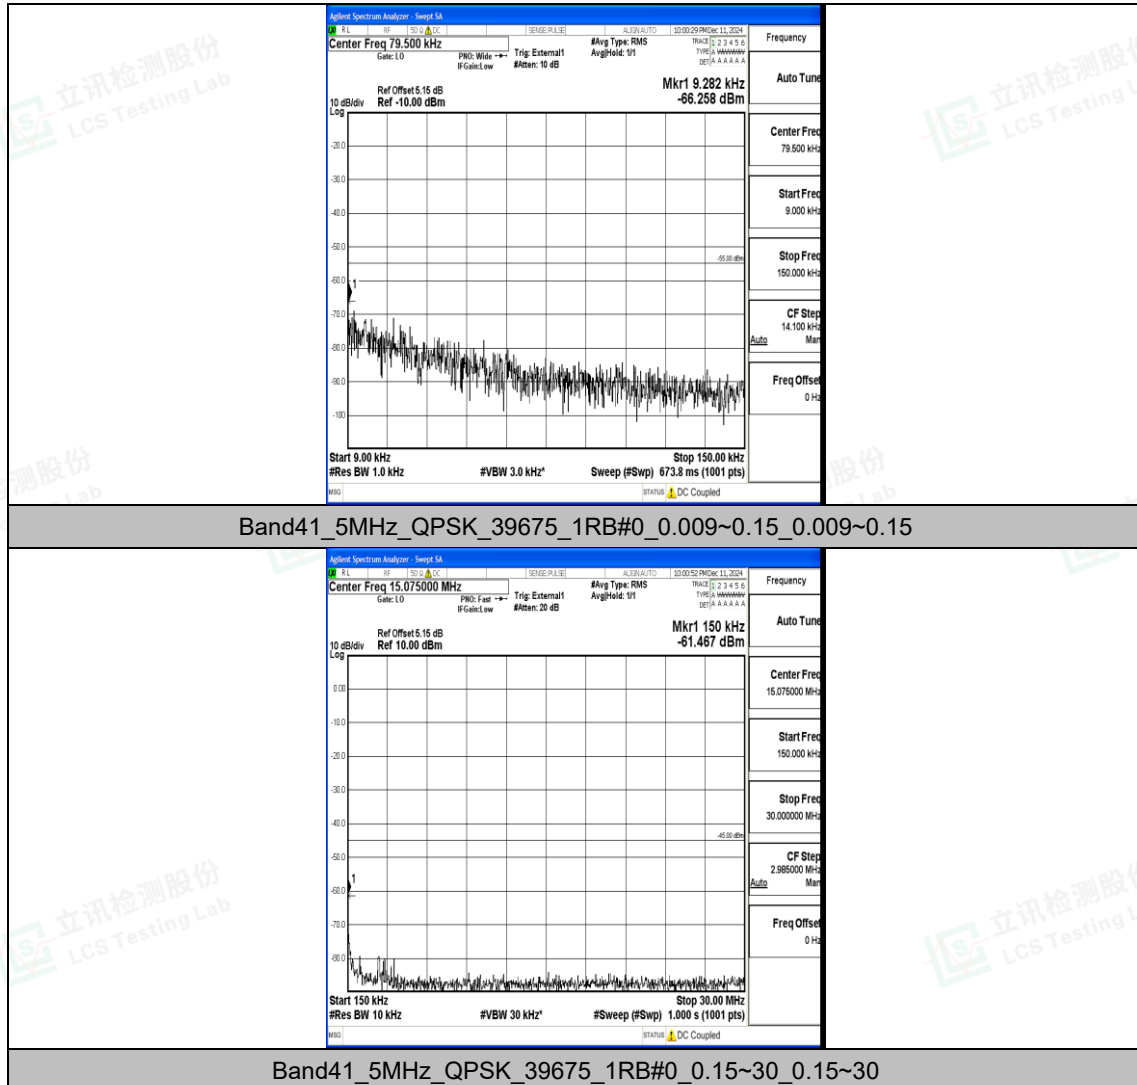

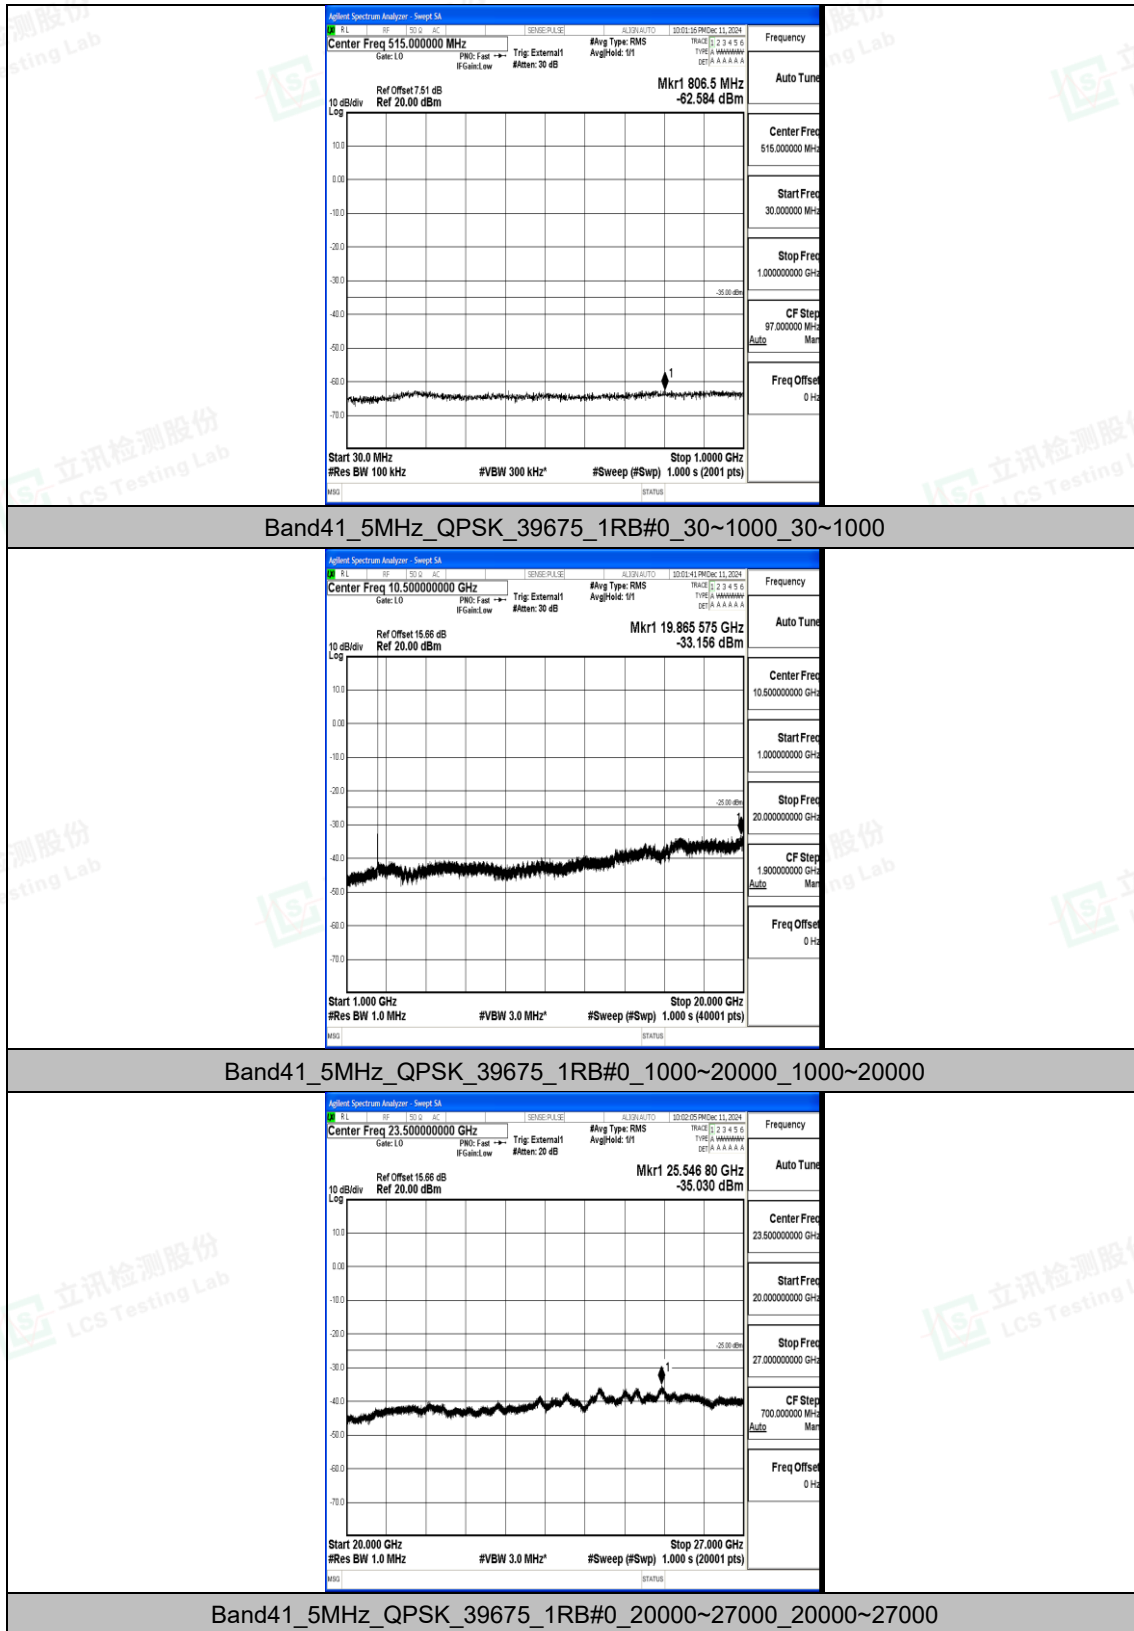


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

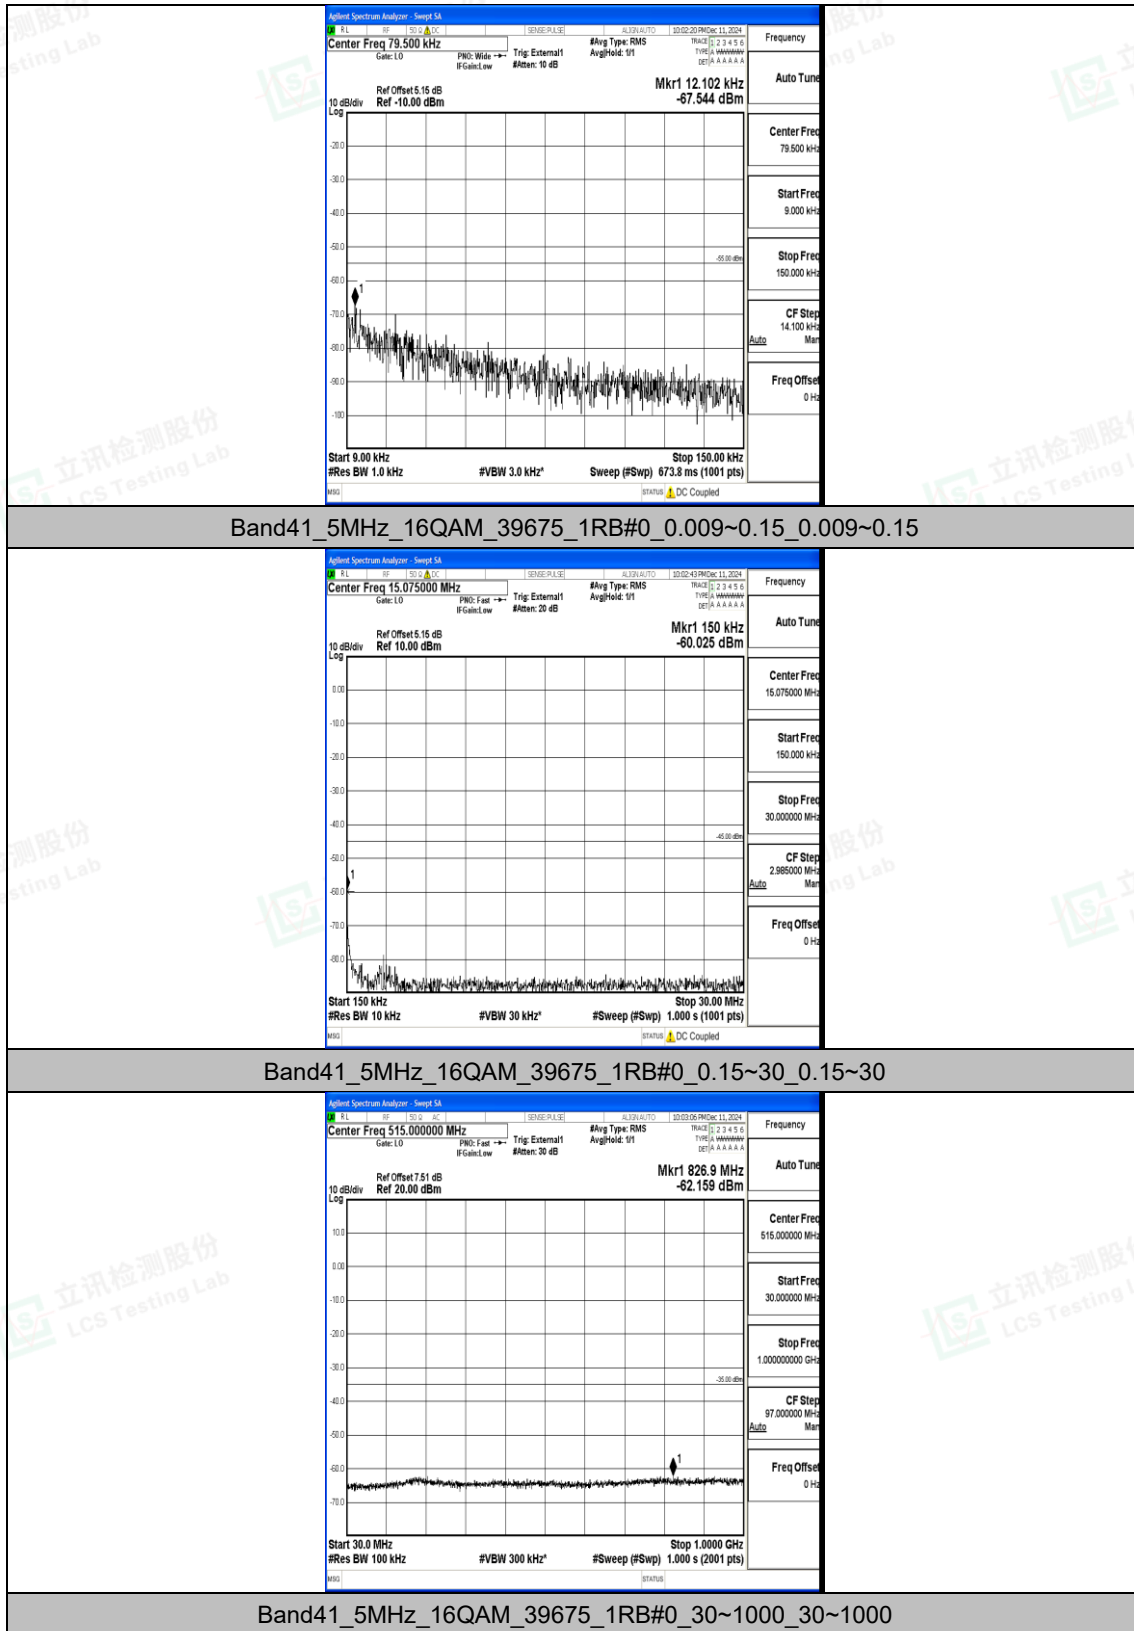


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

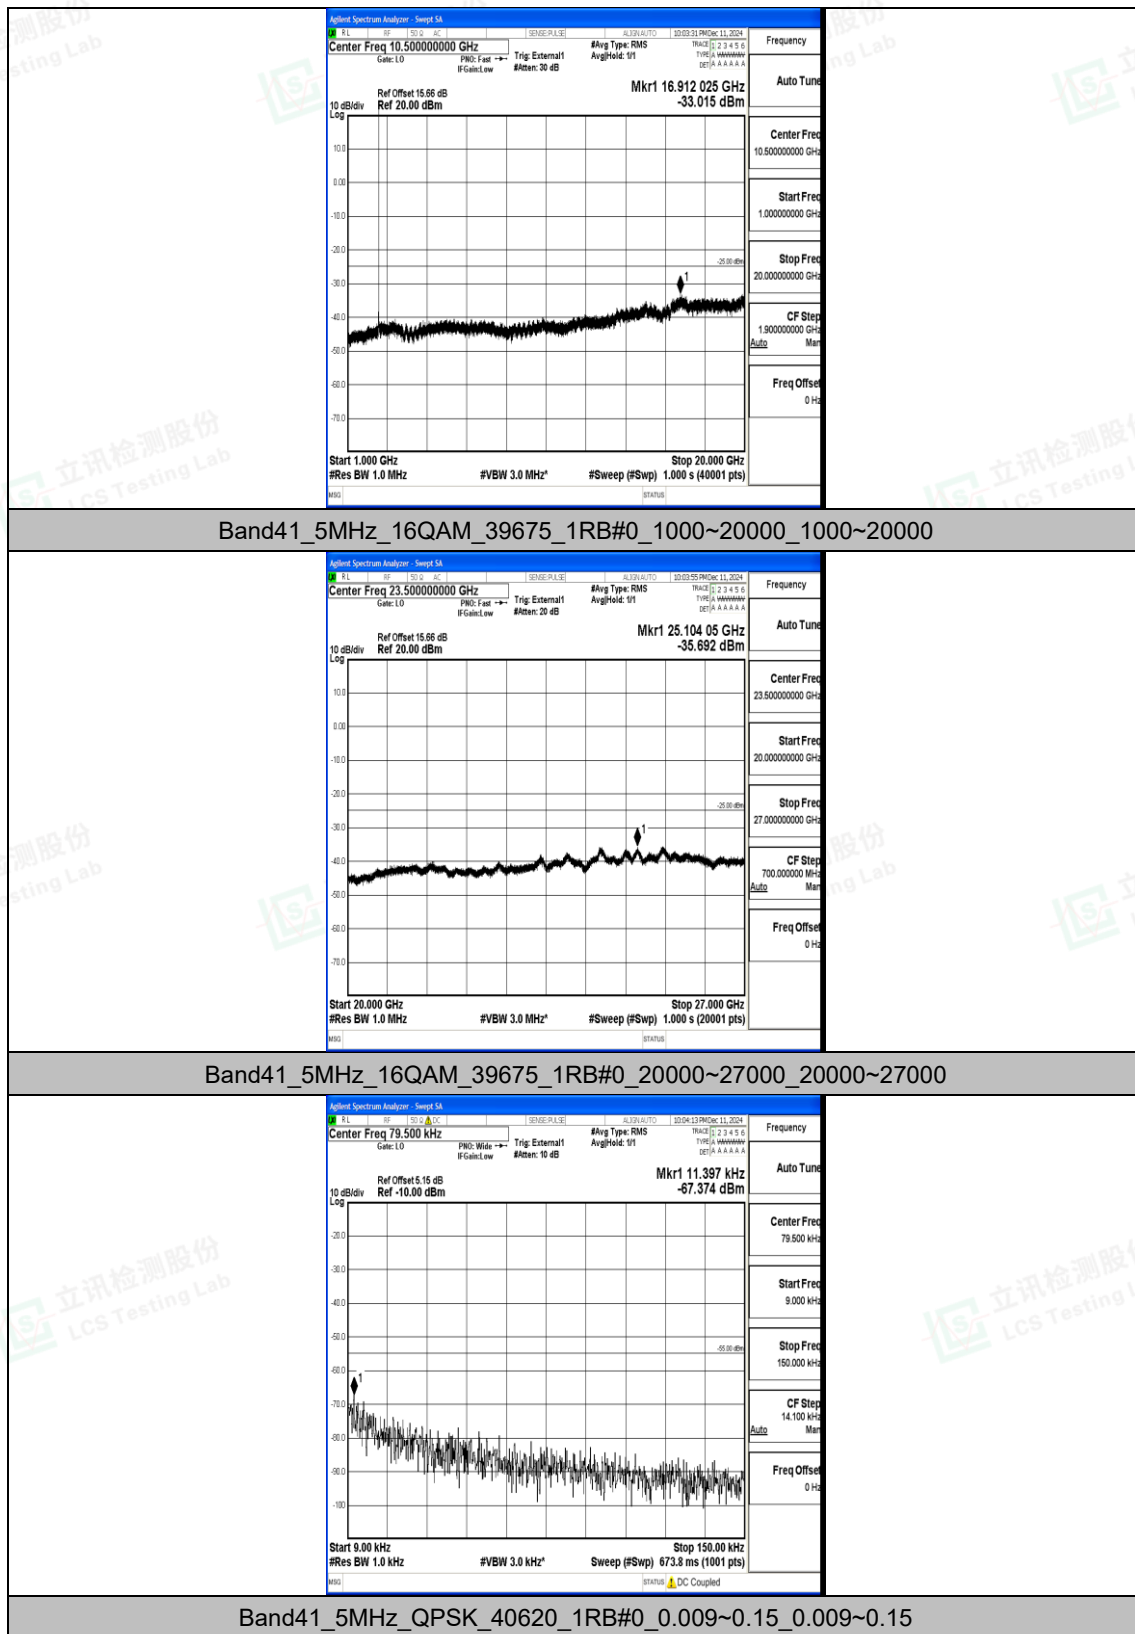

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

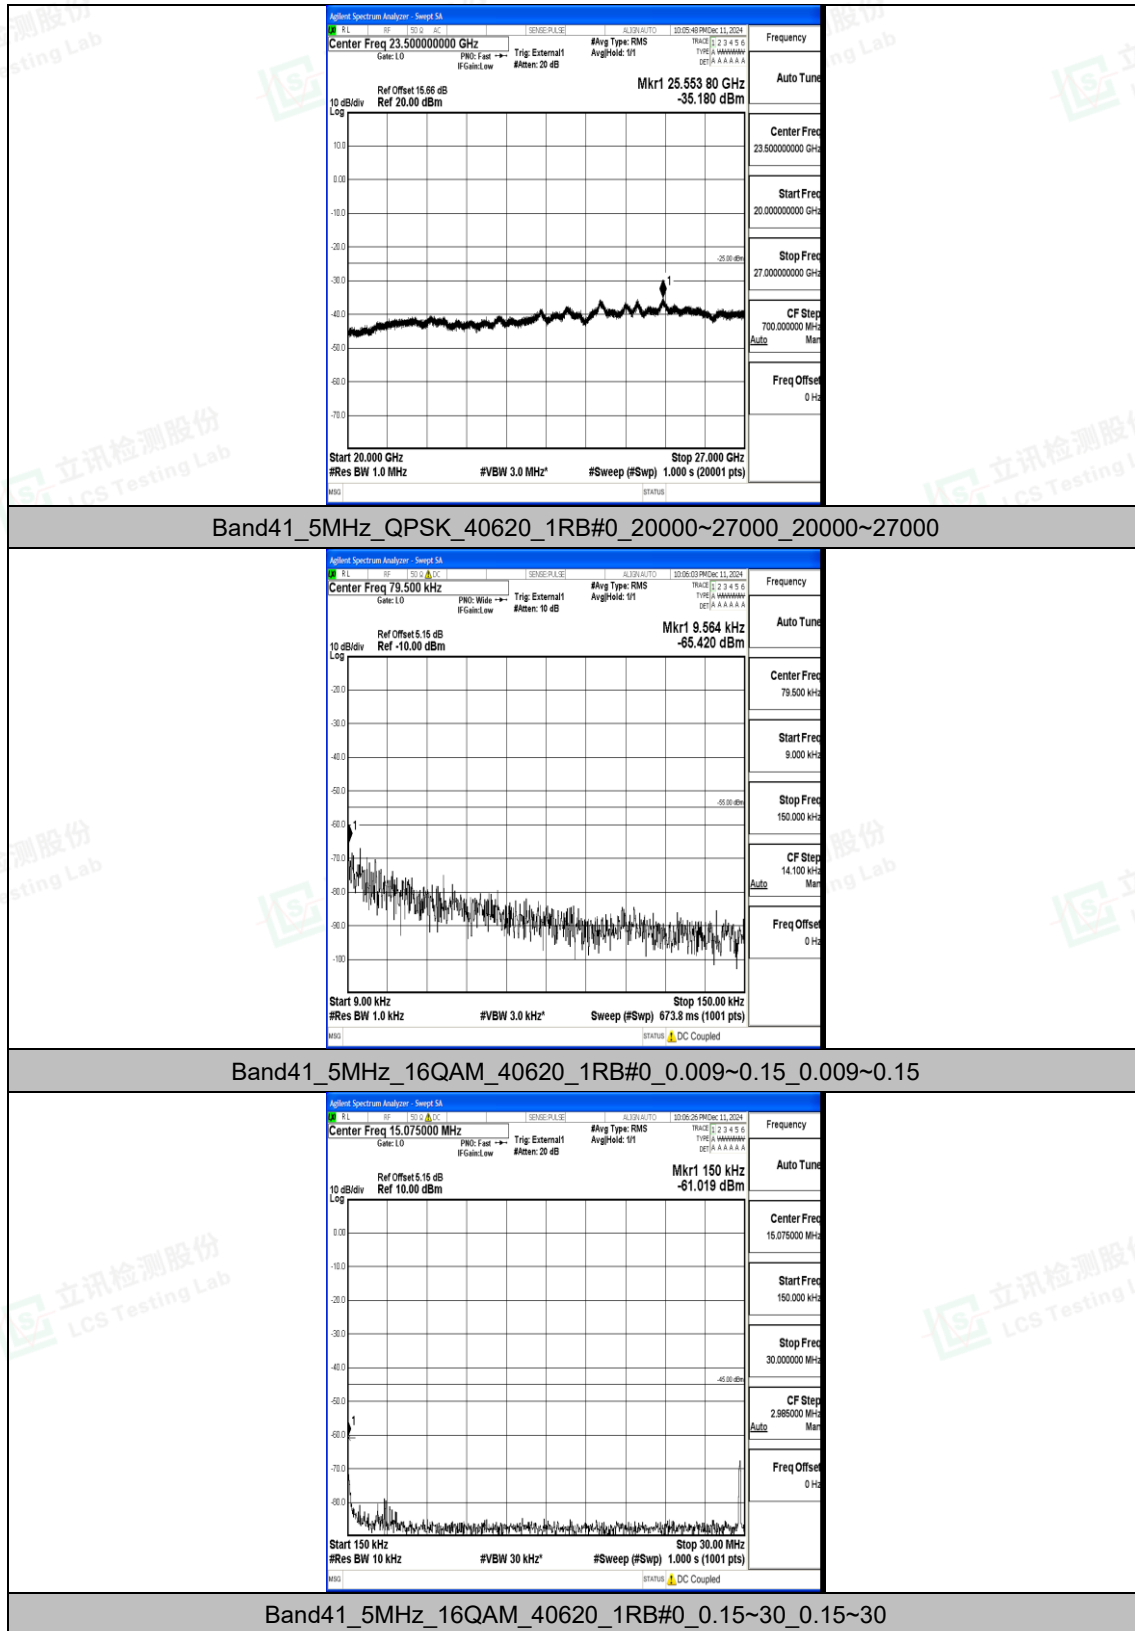


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

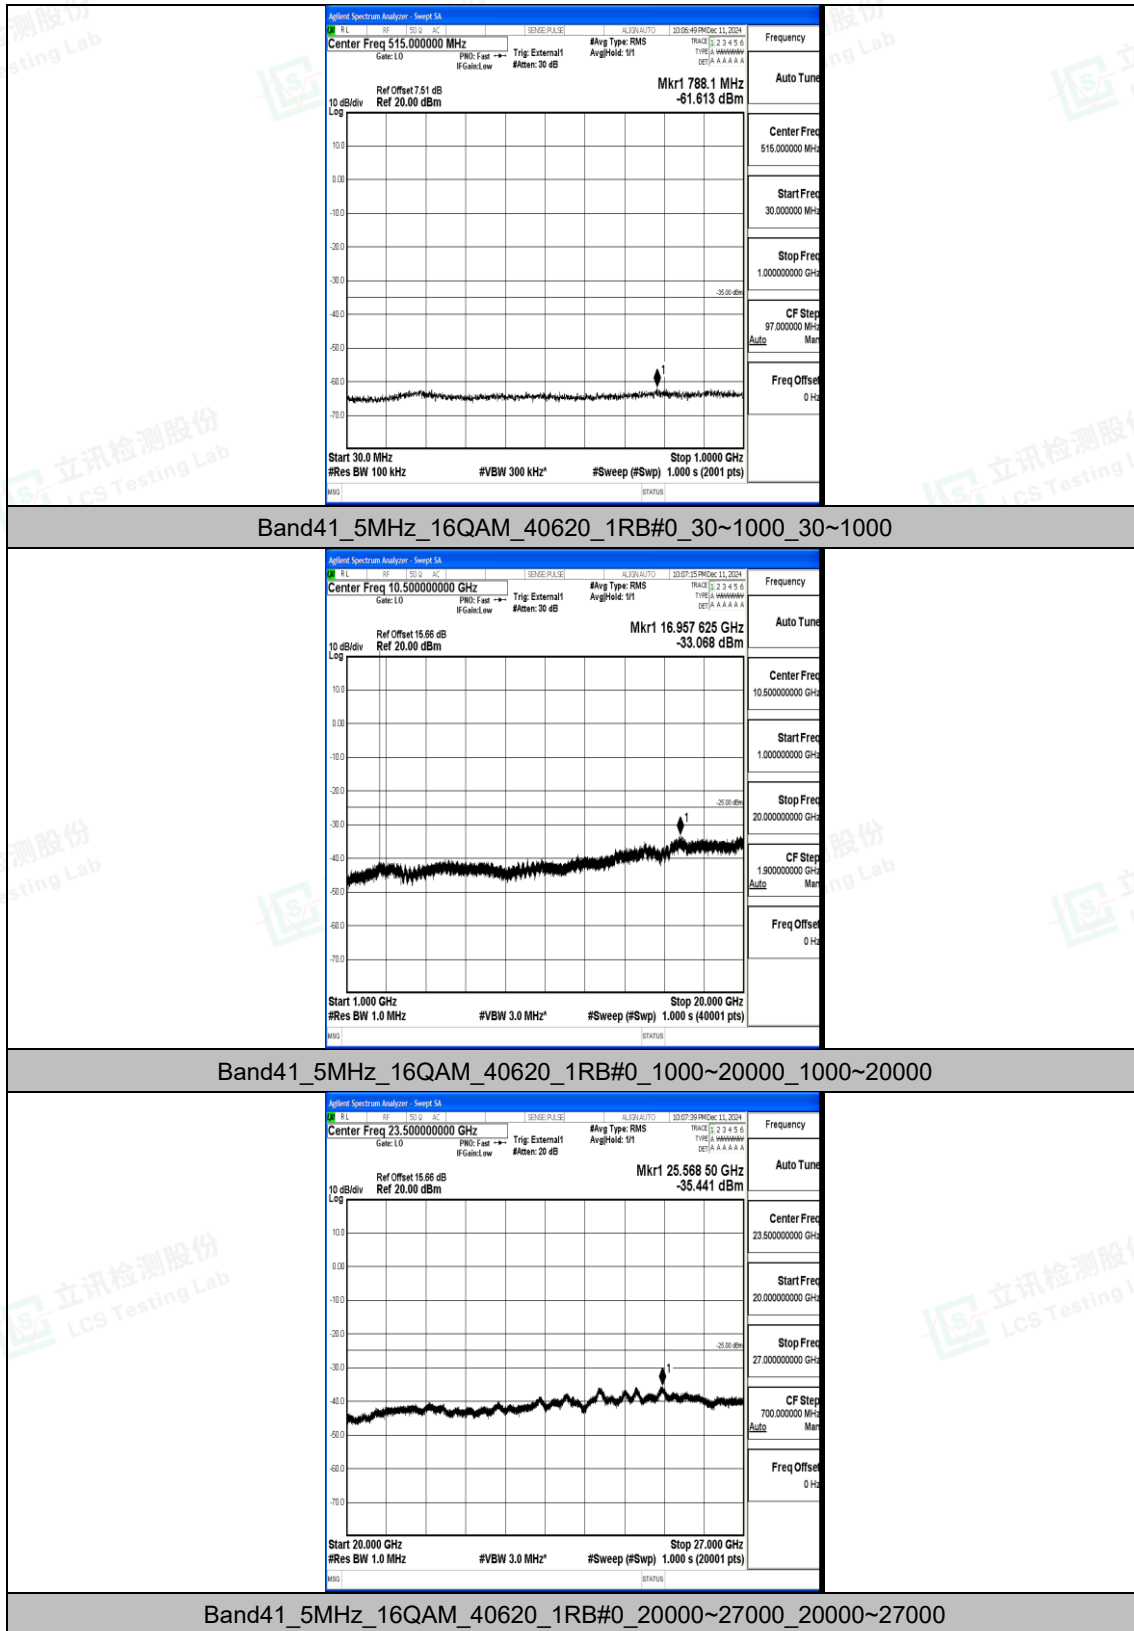


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

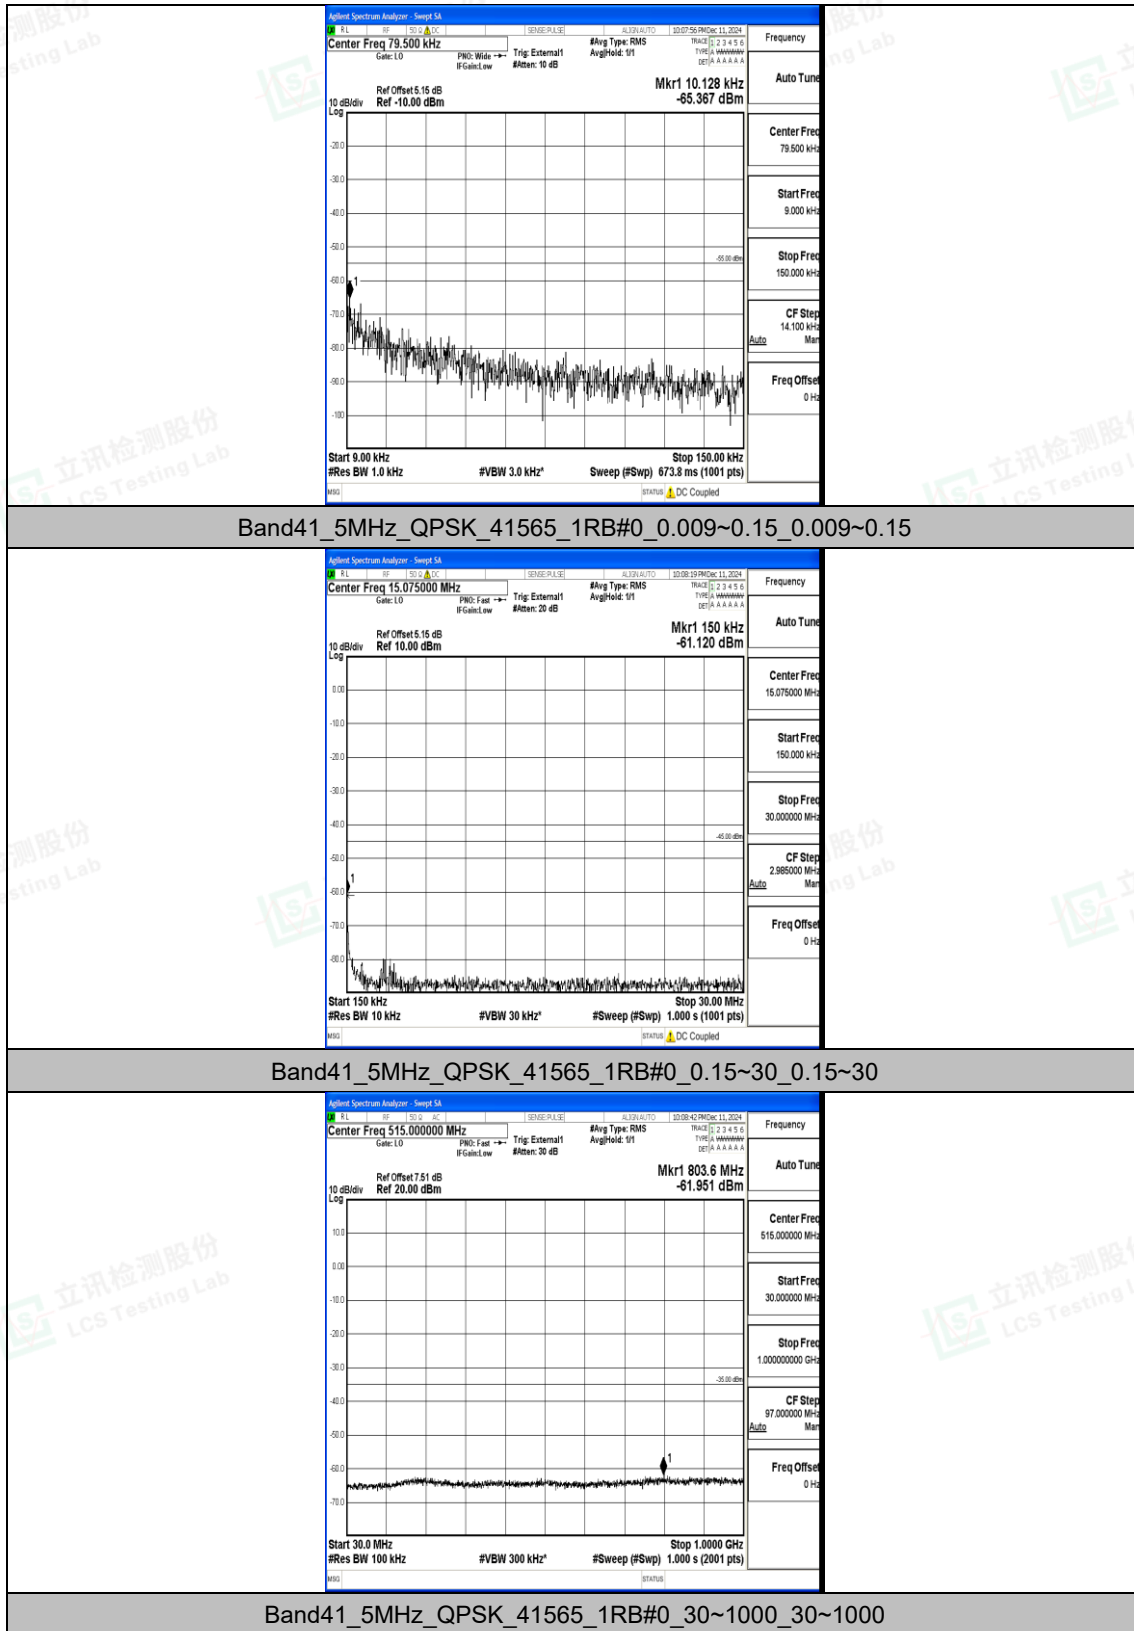

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

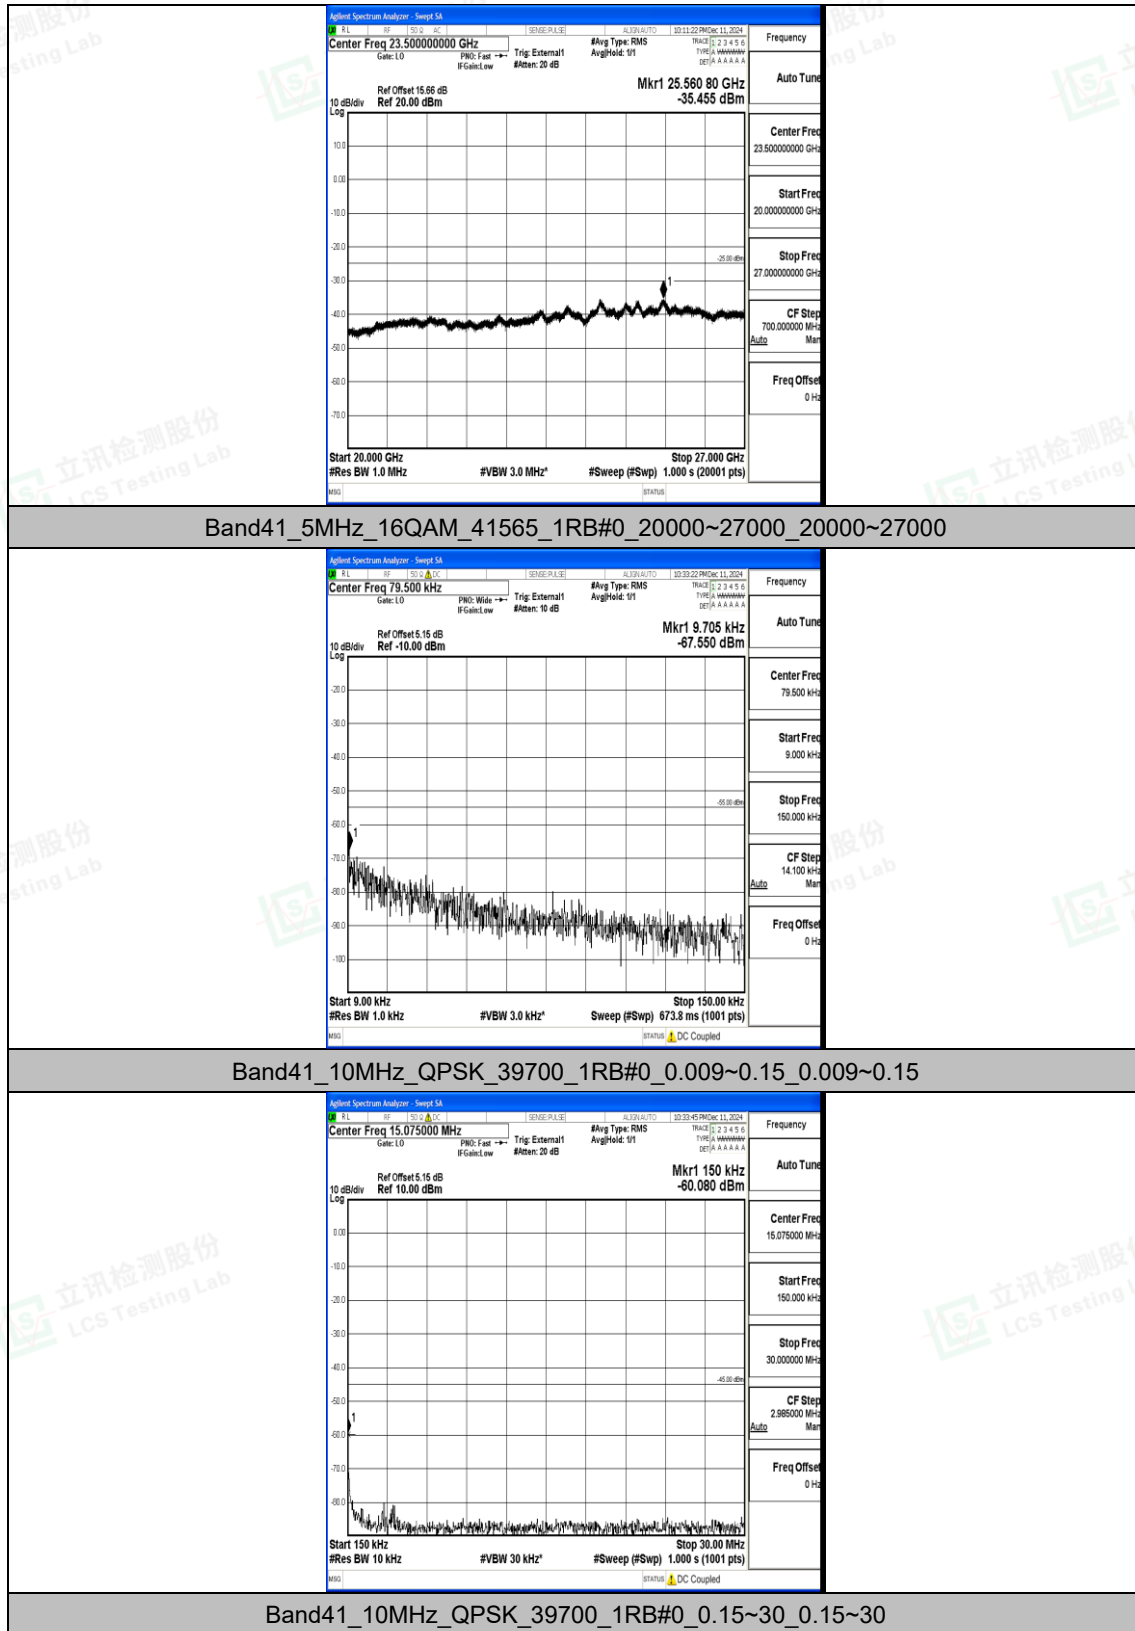


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

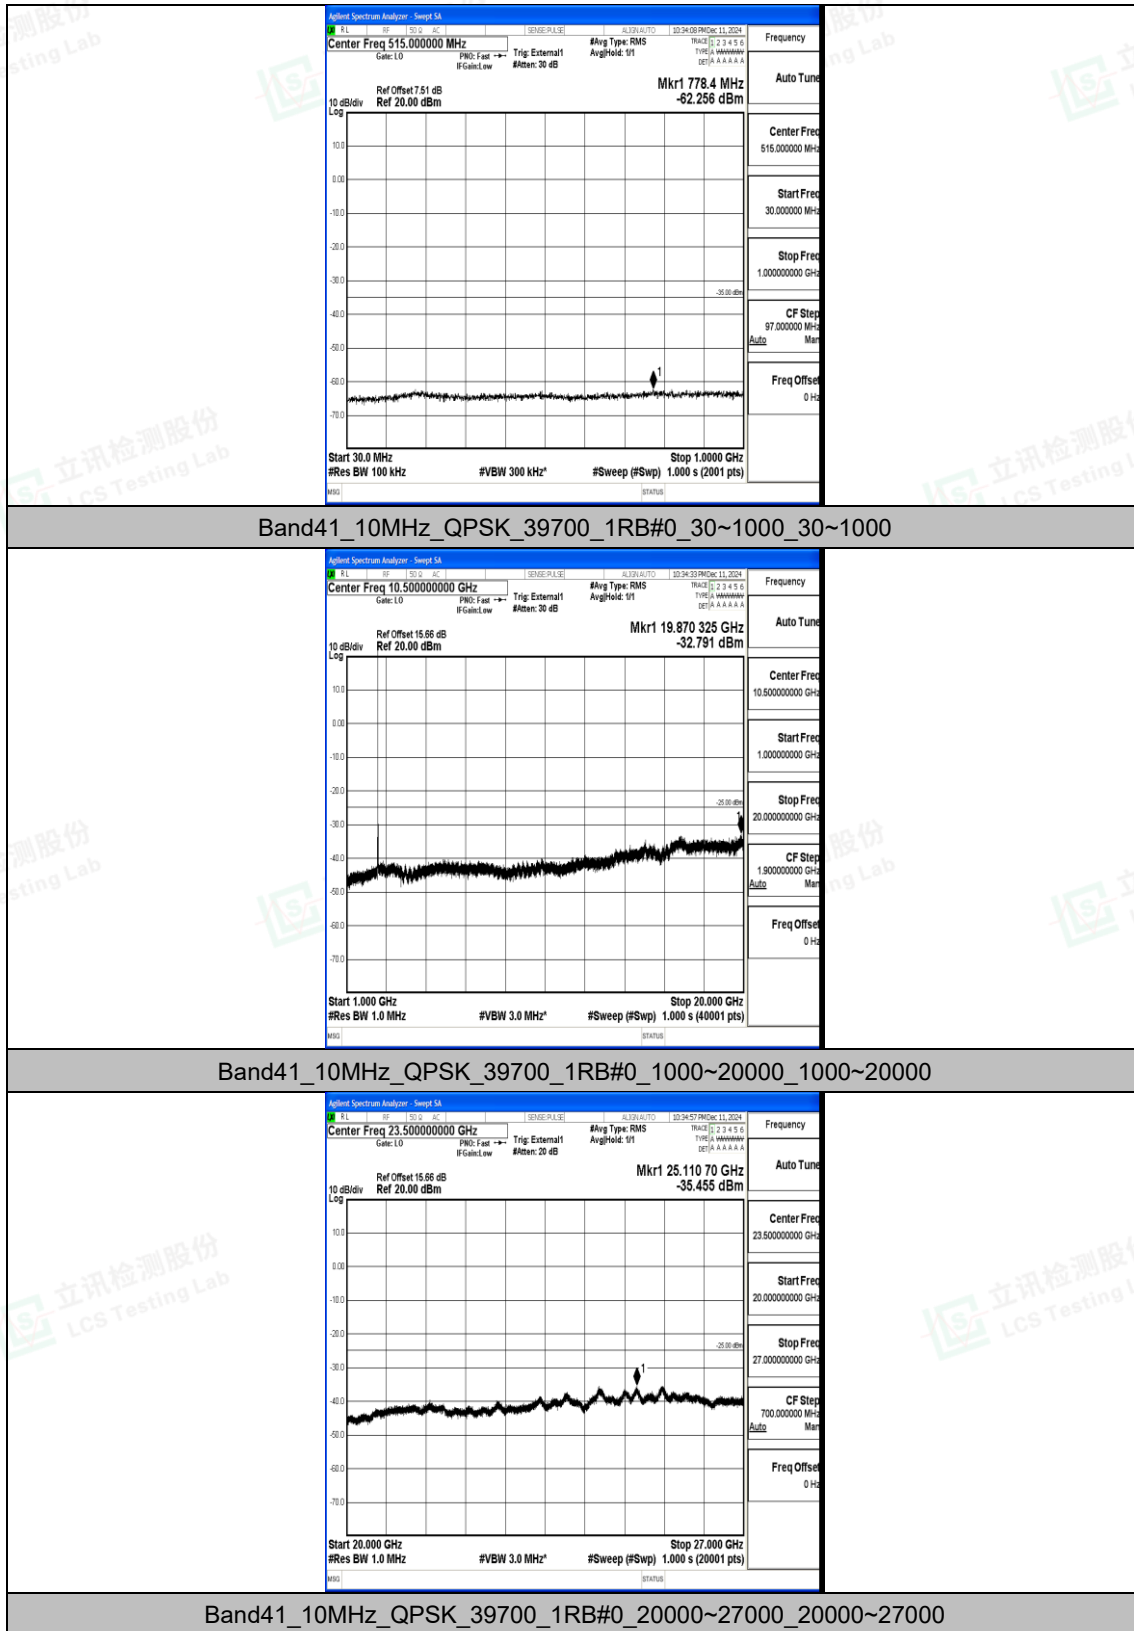


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

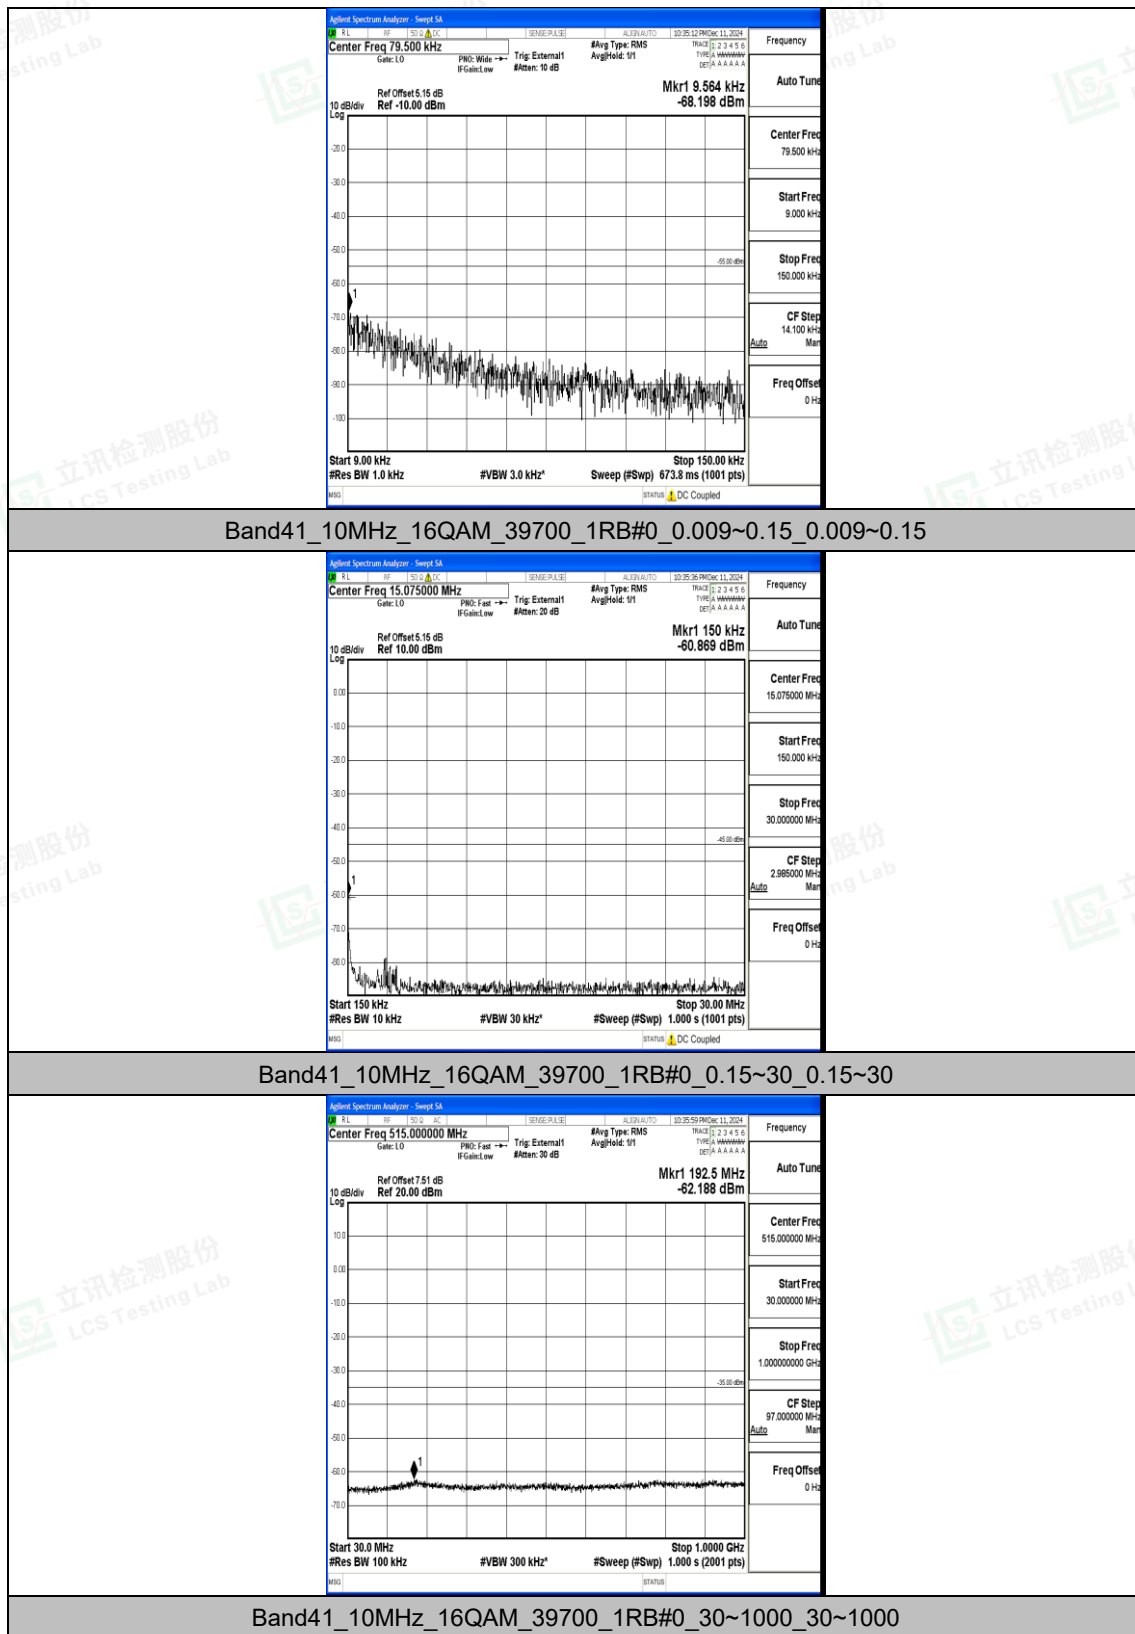


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

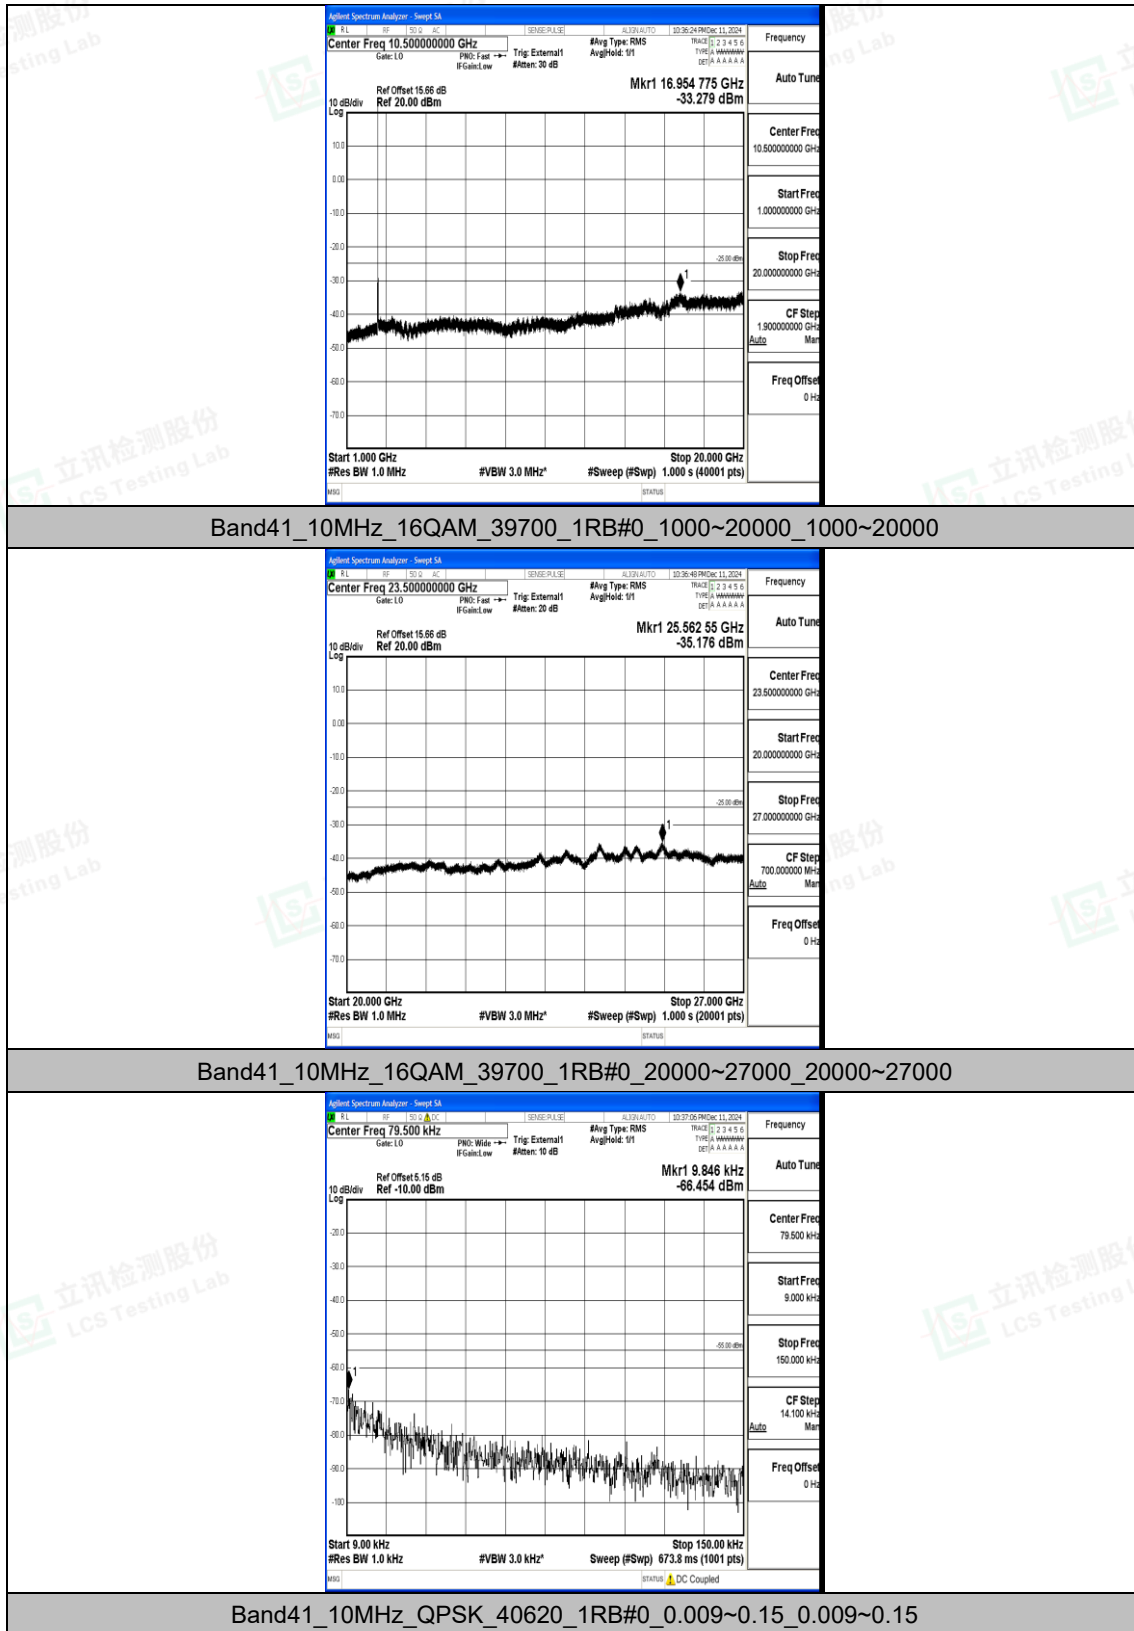


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



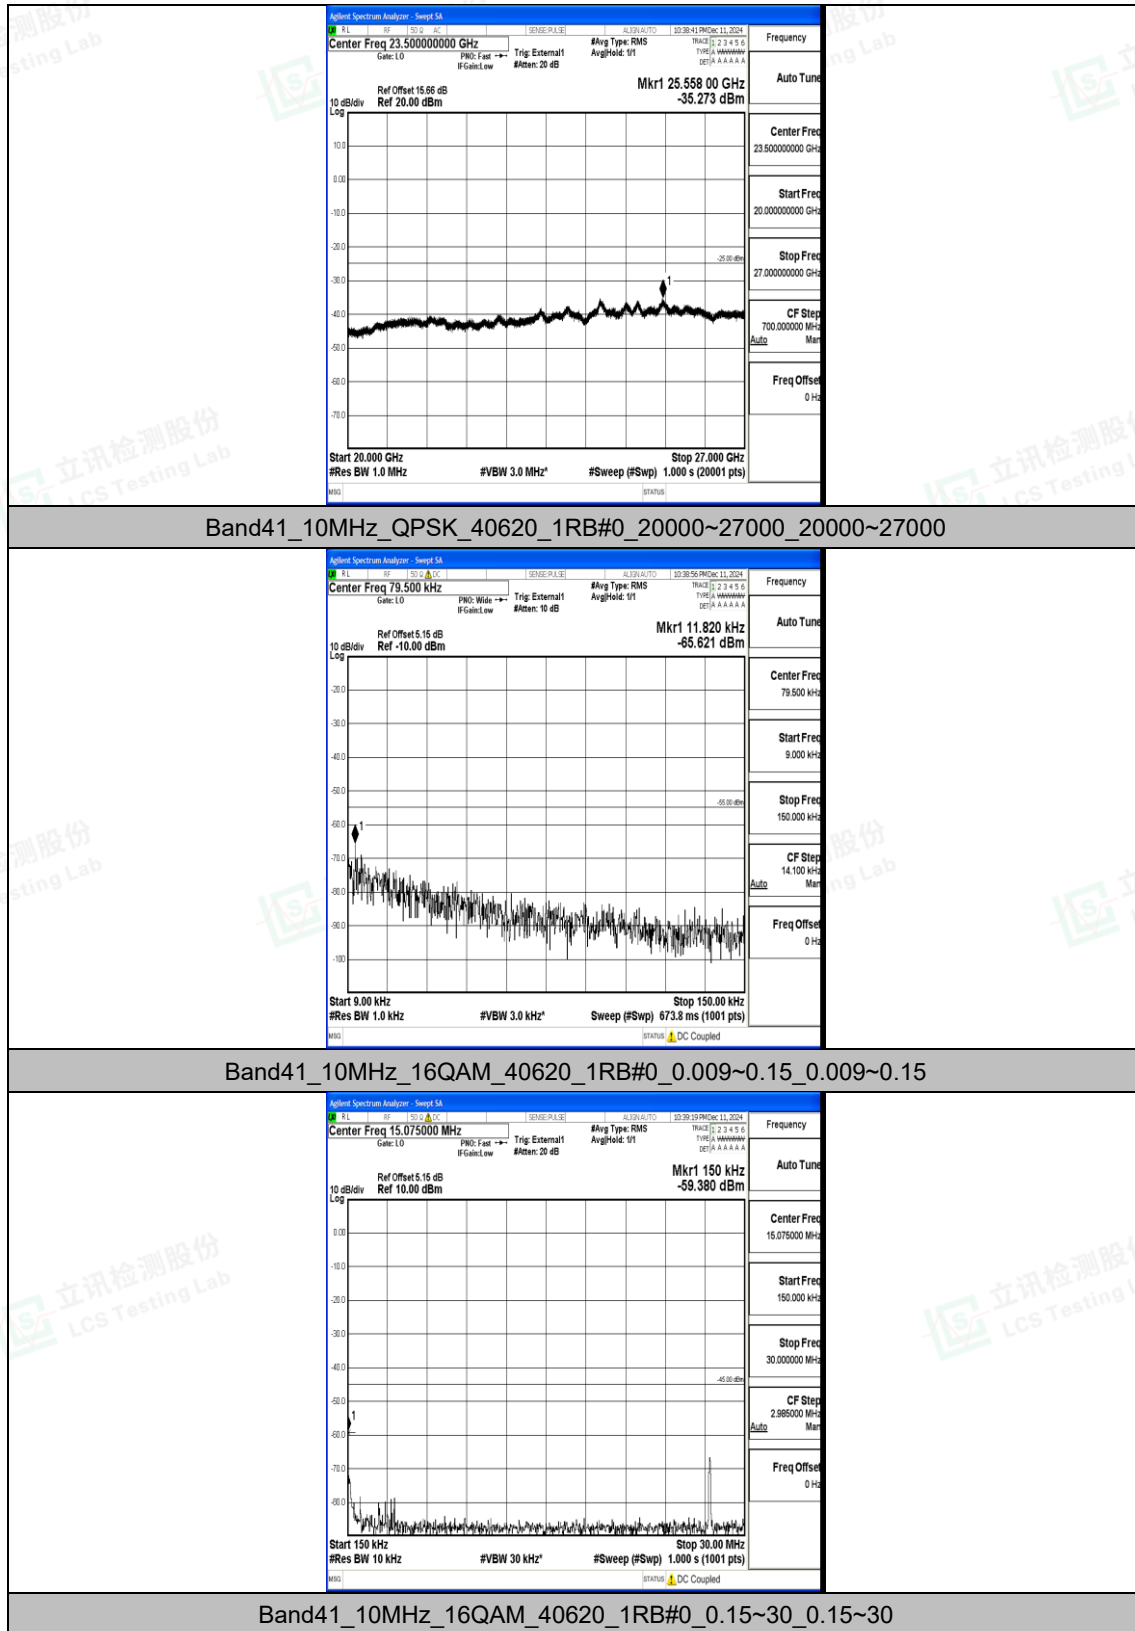

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

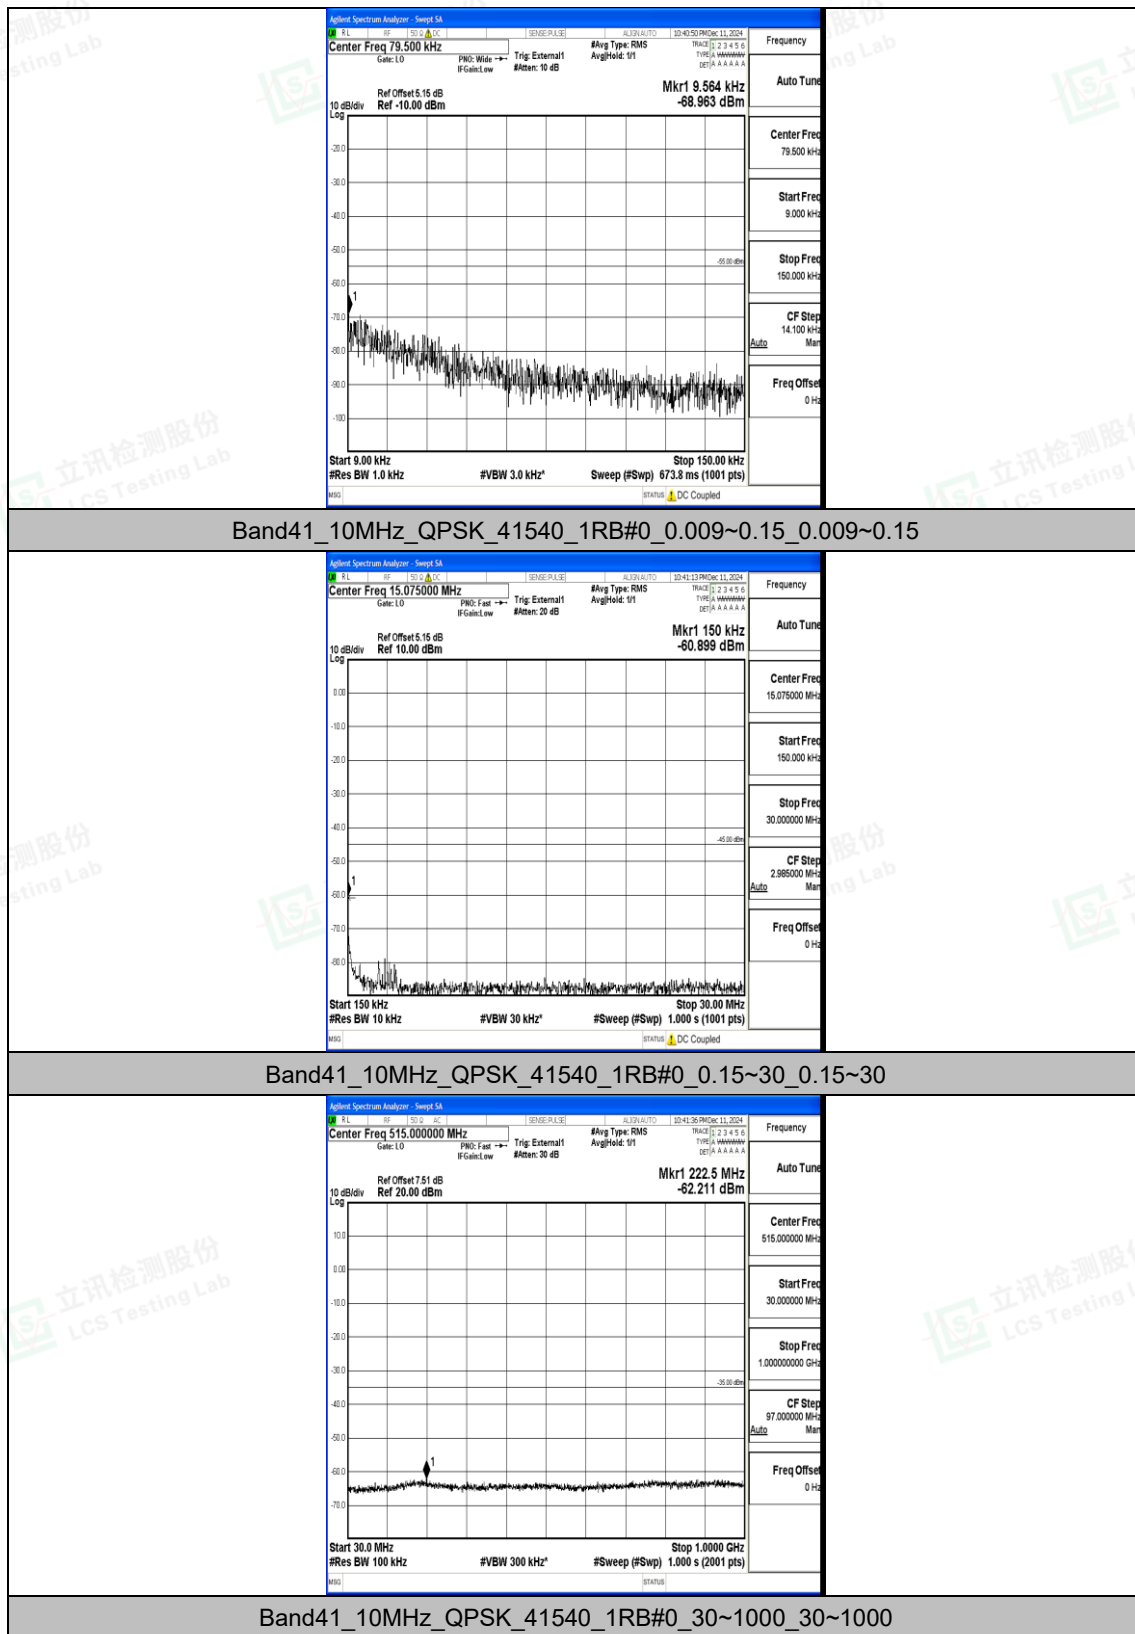

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity