



NVNT	ax20	5240	Ant7	5412.72	-46.51	2	-	50.72	Peak	68.2	Pass
NVNT	ax20	5240	Ant7	5374.08	-56.72	2	2.95	43.46	Average	54	Pass
NVNT	ax20	5240	Ant7	5460	-50.08	2	-	47.15	Peak	68.2	Pass
NVNT	ax20	5240	Ant7	5460	-57.79	2	2.95	42.39	Average	54	Pass
NVNT	ax40	5190	Ant7	4500	-50.52	2	-	46.71	Peak	68.2	Pass
NVNT	ax40	5190	Ant7	4500	-58.63	2	4.75	43.35	Average	54	Pass
NVNT	ax40	5190	Ant7	5082.54	-45.72	2	-	51.51	Peak	68.2	Pass
NVNT	ax40	5190	Ant7	5124.88	-55.92	2	4.75	46.06	Average	54	Pass
NVNT	ax40	5190	Ant7	5150	-48.29	2	-	48.94	Peak	68.2	Pass
NVNT	ax40	5190	Ant7	5150	-56.21	2	4.75	45.77	Average	54	Pass
NVNT	ax40	5230	Ant7	5350	-48.29	2	-	48.94	Peak	68.2	Pass
NVNT	ax40	5230	Ant7	5350	-57.33	2	4.55	44.45	Average	54	Pass
NVNT	ax40	5230	Ant7	5364.15	-45.84	2	-	51.39	Peak	68.2	Pass
NVNT	ax40	5230	Ant7	5392.23	-56.94	2	4.55	44.84	Average	54	Pass
NVNT	ax40	5230	Ant7	5460	-49.5	2	-	47.73	Peak	68.2	Pass
NVNT	ax40	5230	Ant7	5460	-57.78	2	4.55	44	Average	54	Pass
NVNT	ax80	5210	Ant7	5350	-49.61	2	-	47.62	Peak	68.2	Pass
NVNT	ax80	5210	Ant7	5350	-57.85	2	6.48	45.86	Average	54	Pass
NVNT	ax80	5210	Ant7	5455.71	-46.74	2	-	50.49	Peak	68.2	Pass
NVNT	ax80	5210	Ant7	5359.68	-56.51	2	6.48	47.2	Average	54	Pass
NVNT	ax80	5210	Ant7	5460	-49.3	2	-	47.93	Peak	68.2	Pass
NVNT	ax80	5210	Ant7	5460	-57.13	2	6.48	46.58	Average	54	Pass
NVNT	ax80	5210	Ant7	4500	-50.93	2	-	46.3	Peak	68.2	Pass
NVNT	ax80	5210	Ant7	4500	-57.66	2	6.48	46.05	Average	54	Pass
NVNT	ax80	5210	Ant7	5136.74	-42.6	2	-	54.63	Peak	68.2	Pass
NVNT	ax80	5210	Ant7	5149.38	-55.11	2	6.48	48.6	Average	54	Pass
NVNT	ax80	5210	Ant7	5150	-44.9	2	-	52.33	Peak	68.2	Pass
NVNT	ax80	5210	Ant7	5150	-55.45	2	6.48	48.26	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant7 Peak

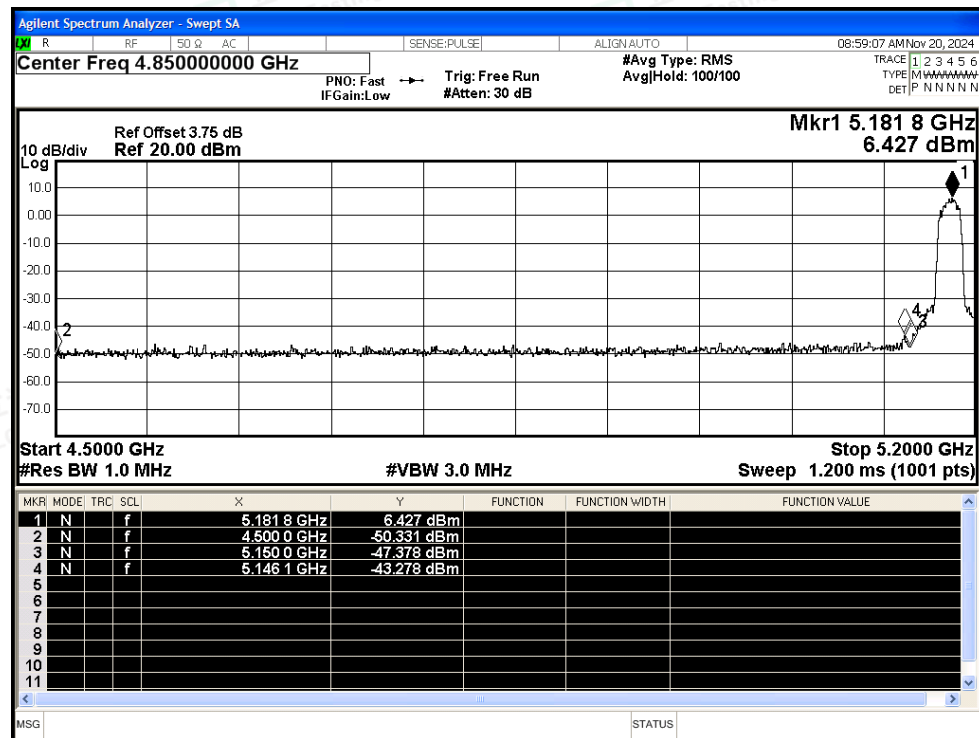

Restrict Band NVNT a 5180MHz Ant7 Average

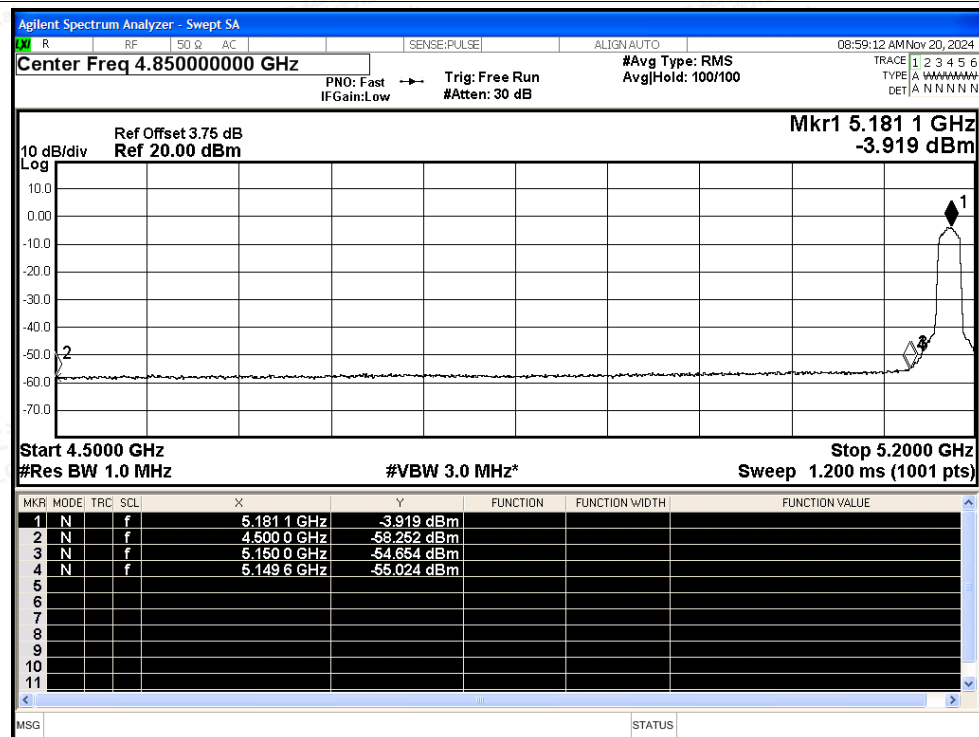

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant7 Peak

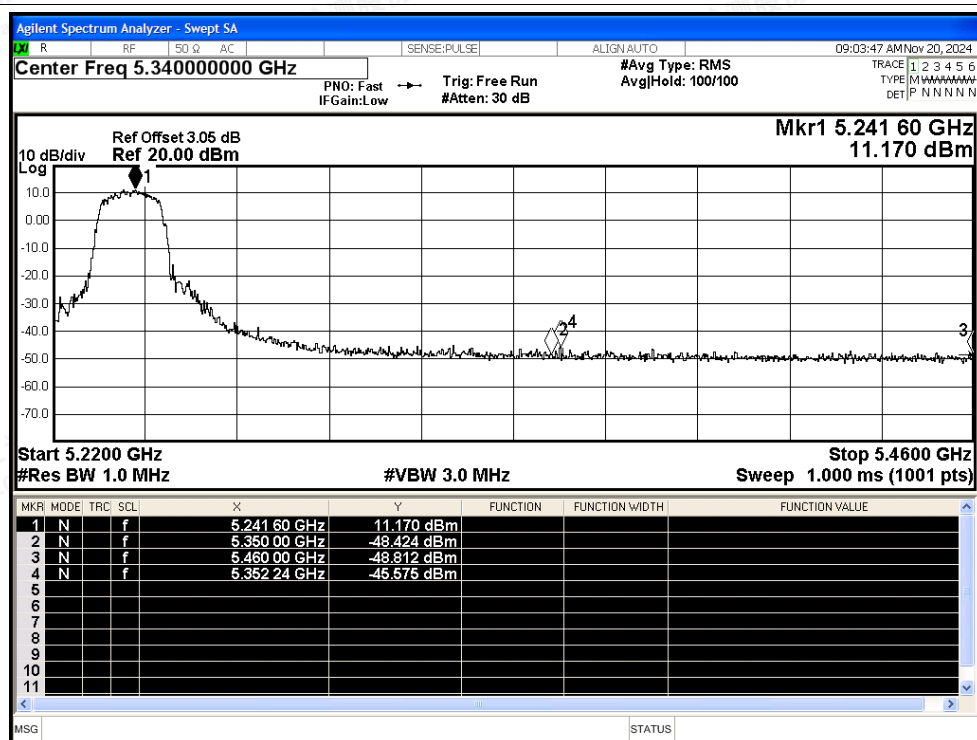

Restrict Band NVNT a 5240MHz Ant7 Average

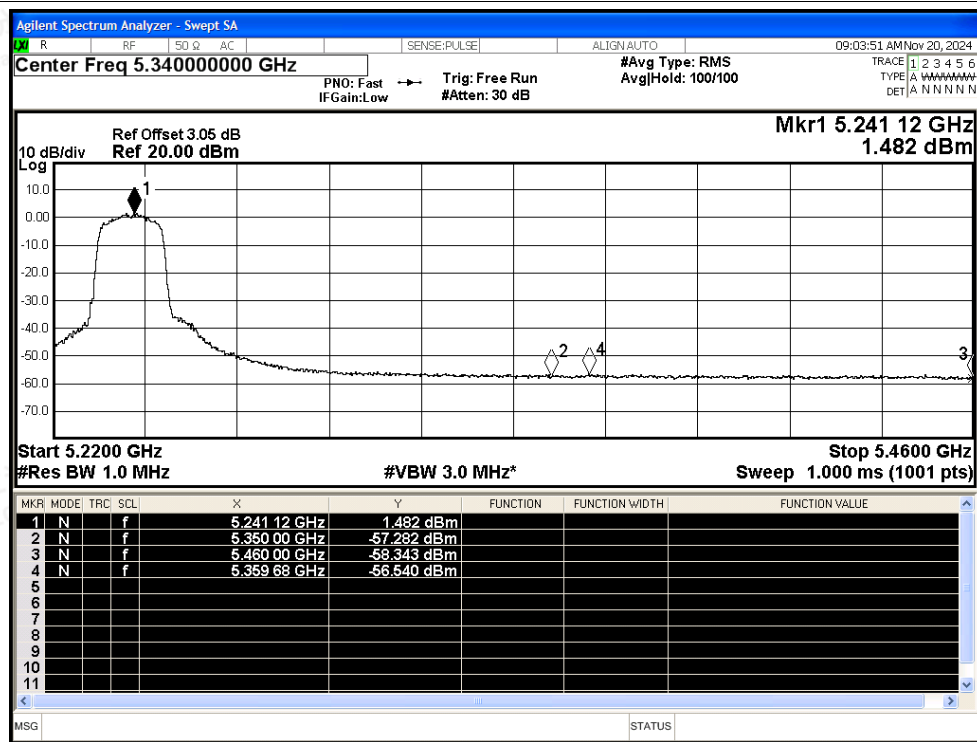

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant7 Peak

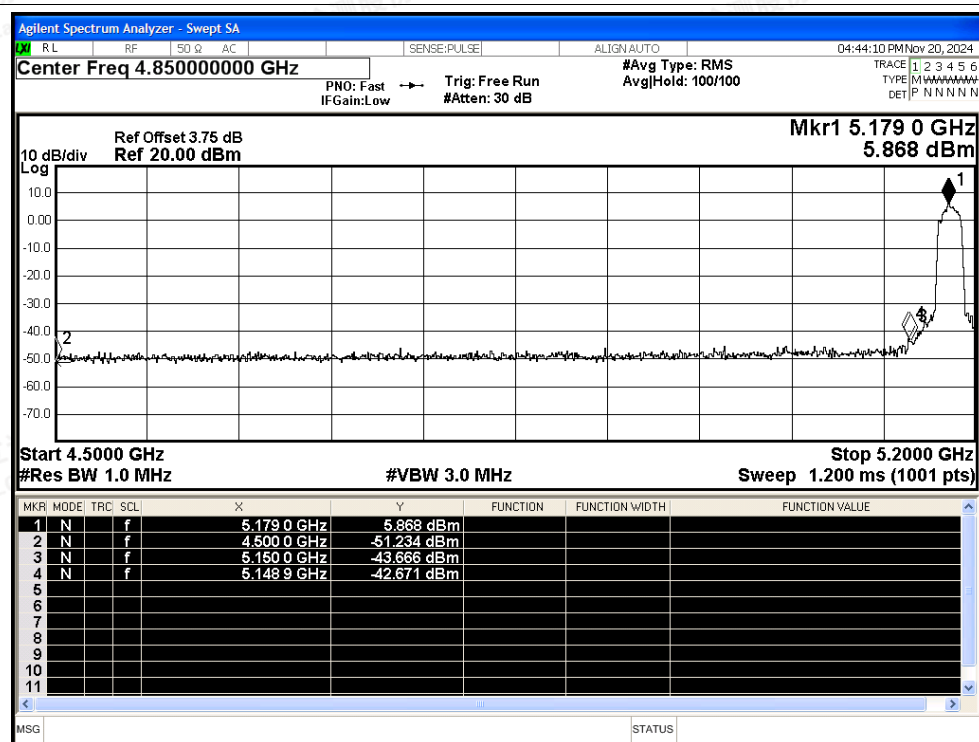

Restrict Band NVNT n20 5180MHz Ant7 Average

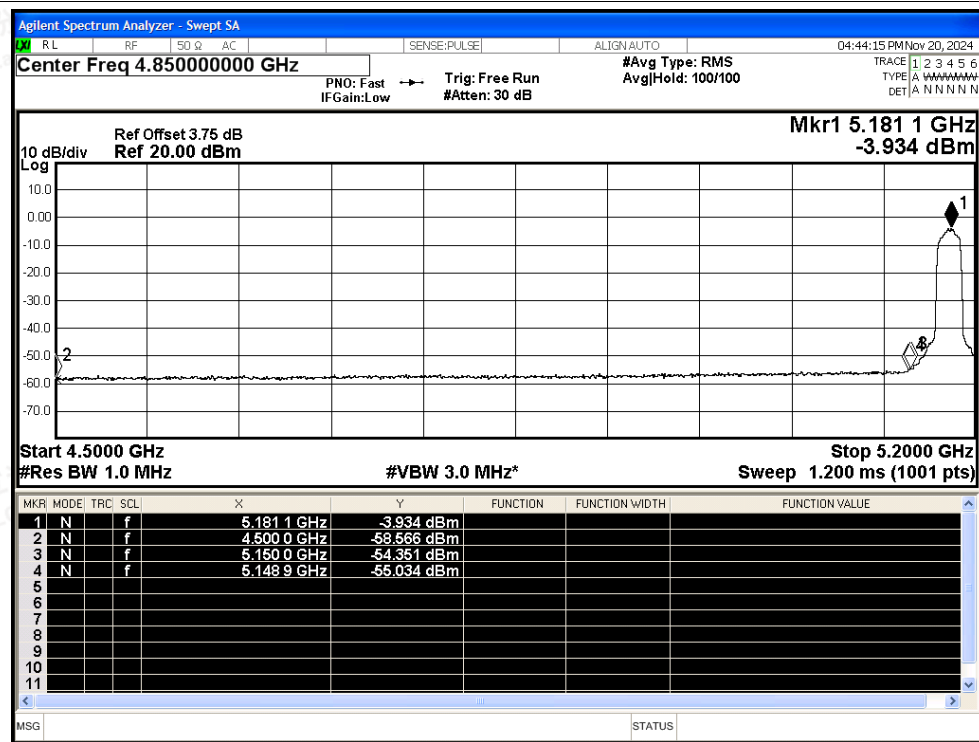

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant7 Peak

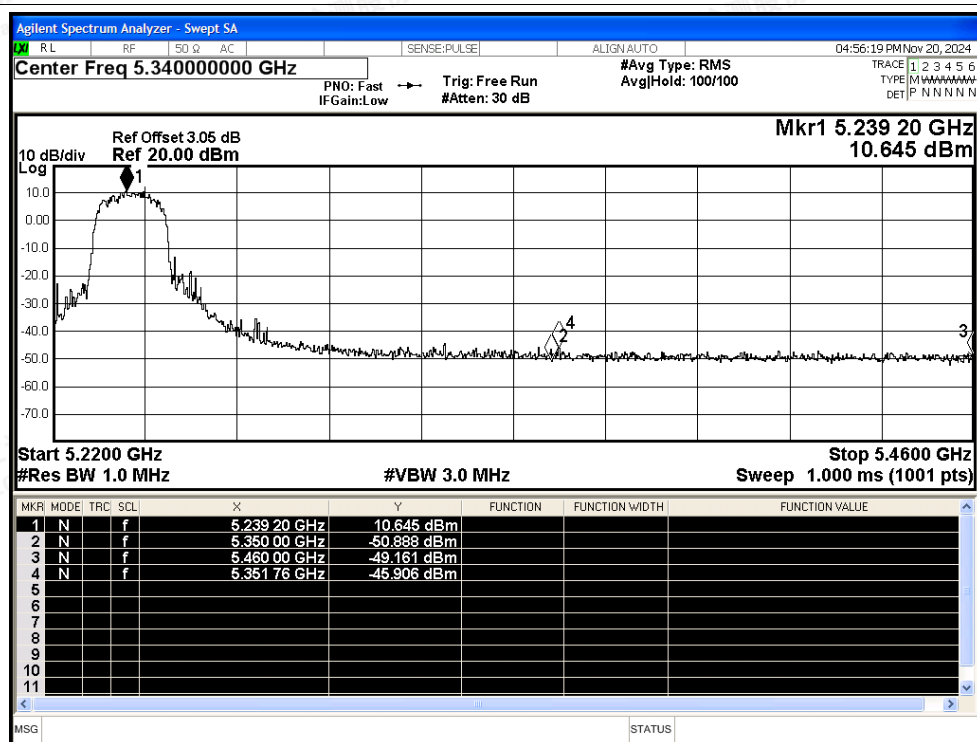

Restrict Band NVNT n20 5240MHz Ant7 Average

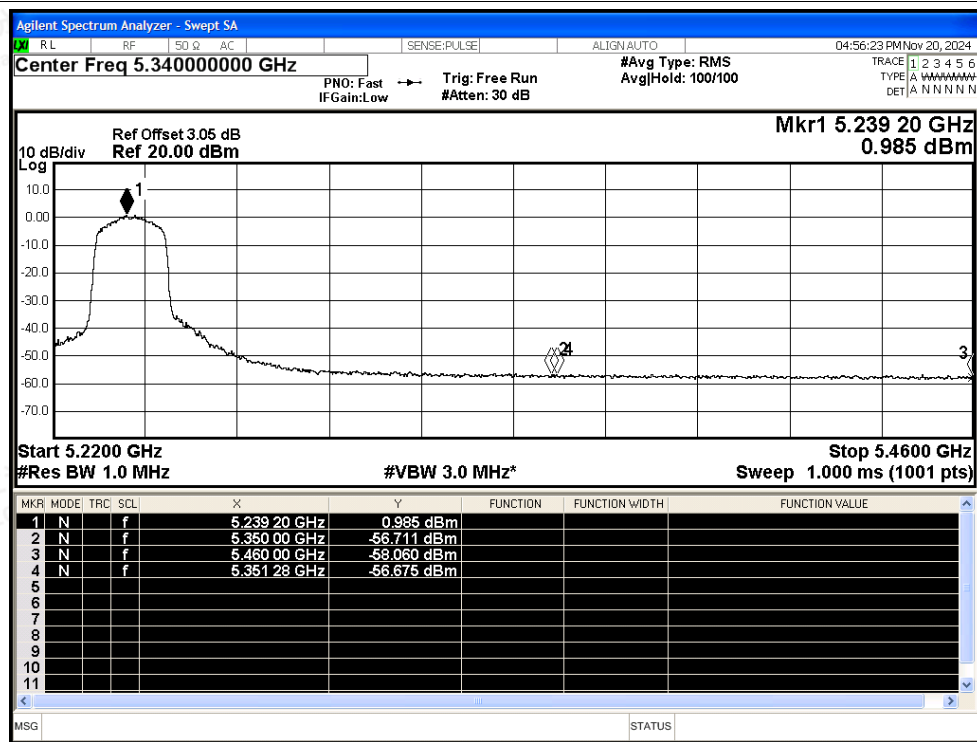

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant7 Peak

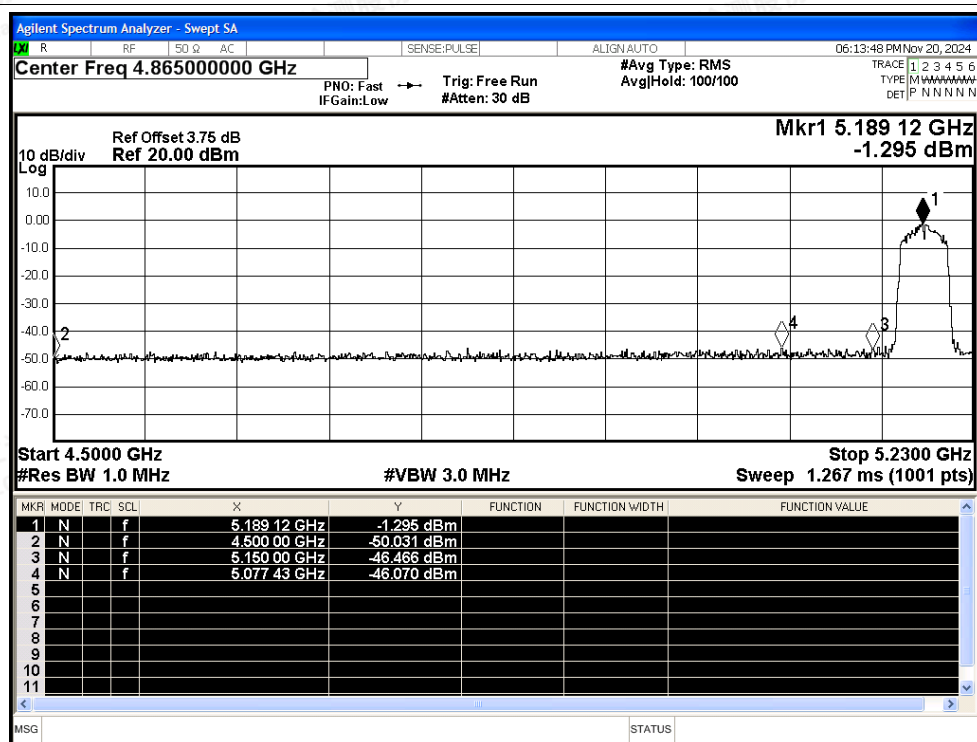

Restrict Band NVNT n40 5190MHz Ant7 Average

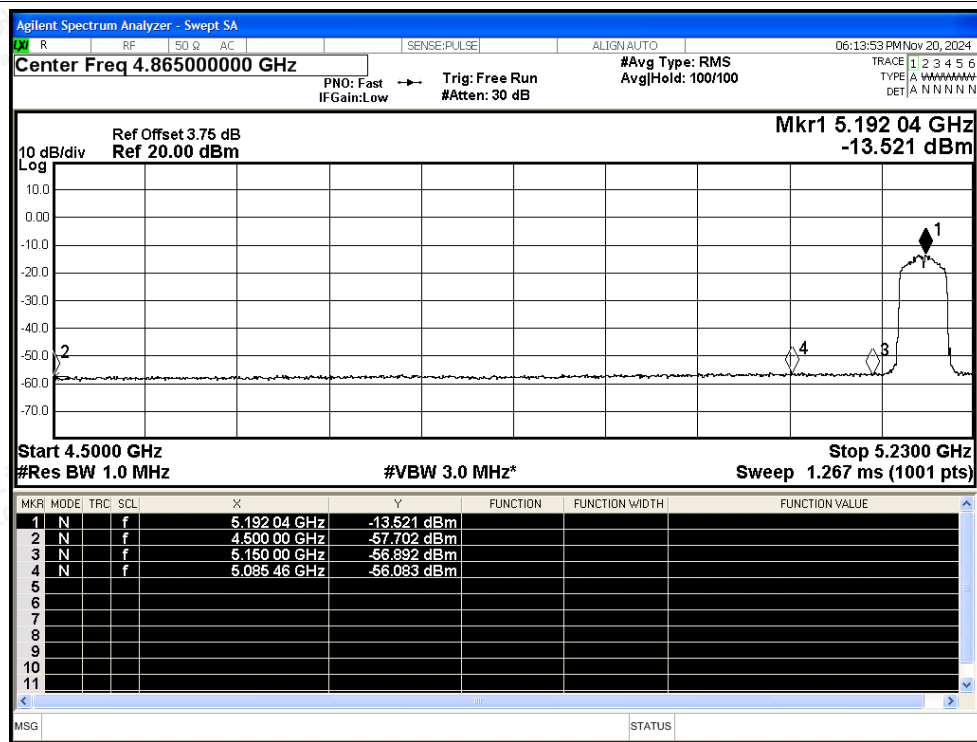

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant7 Peak

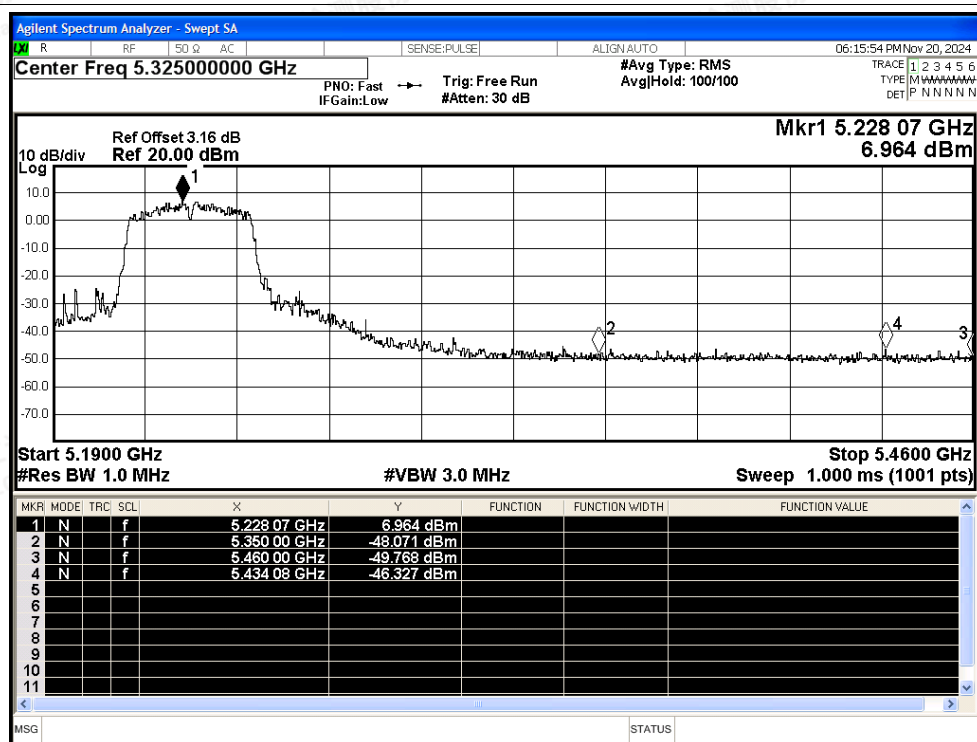

Restrict Band NVNT n40 5230MHz Ant7 Average

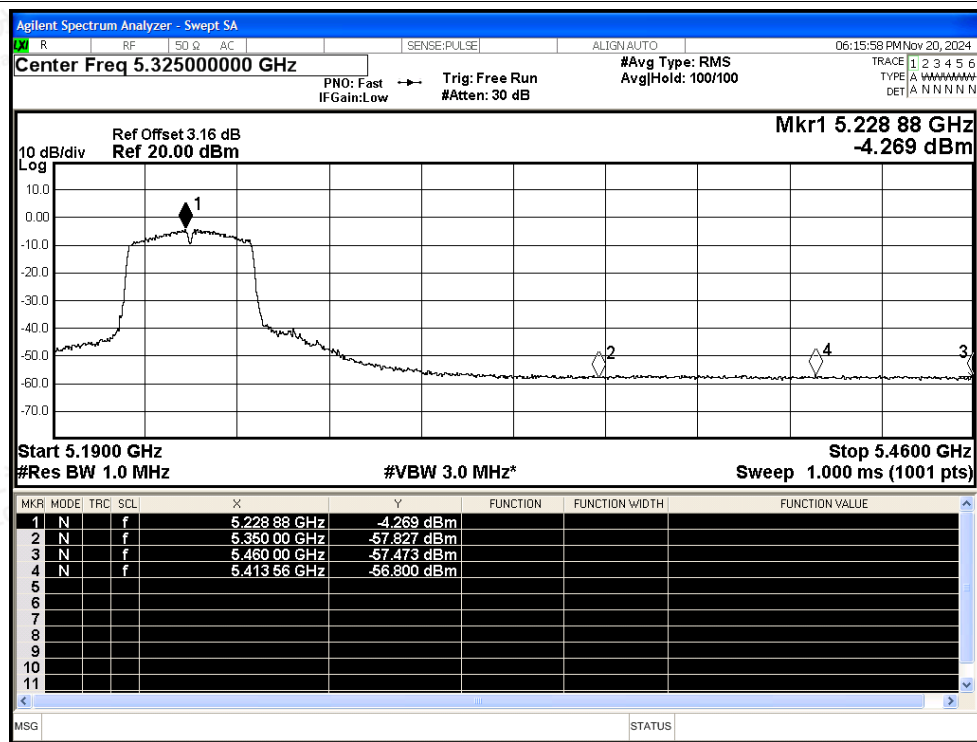

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant7 Peak

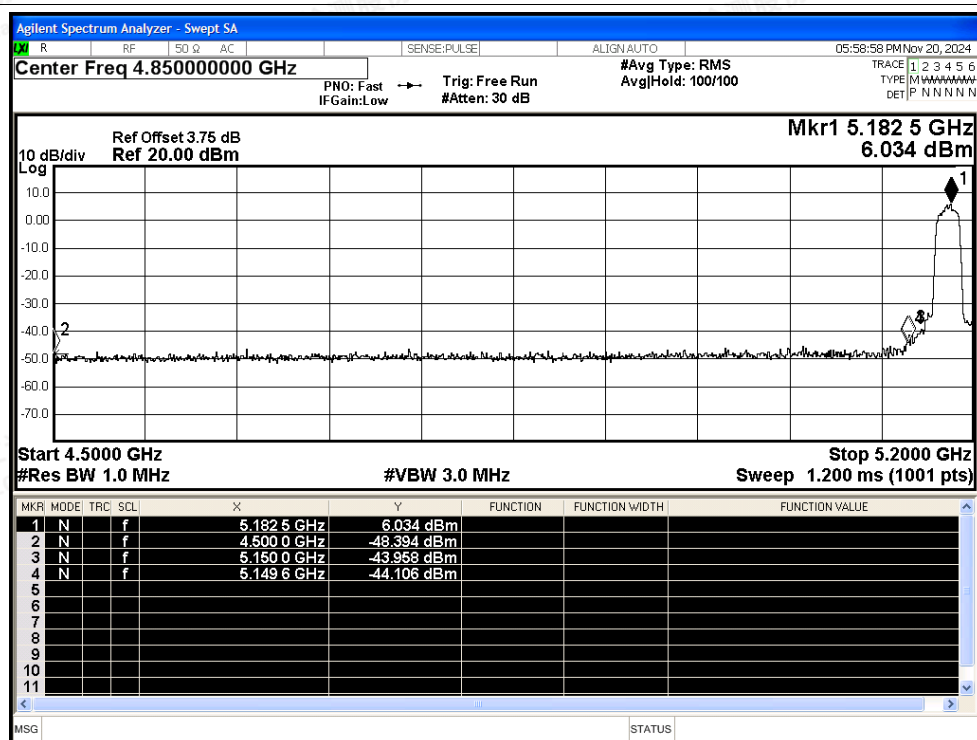

Restrict Band NVNT ac20 5180MHz Ant7 Average

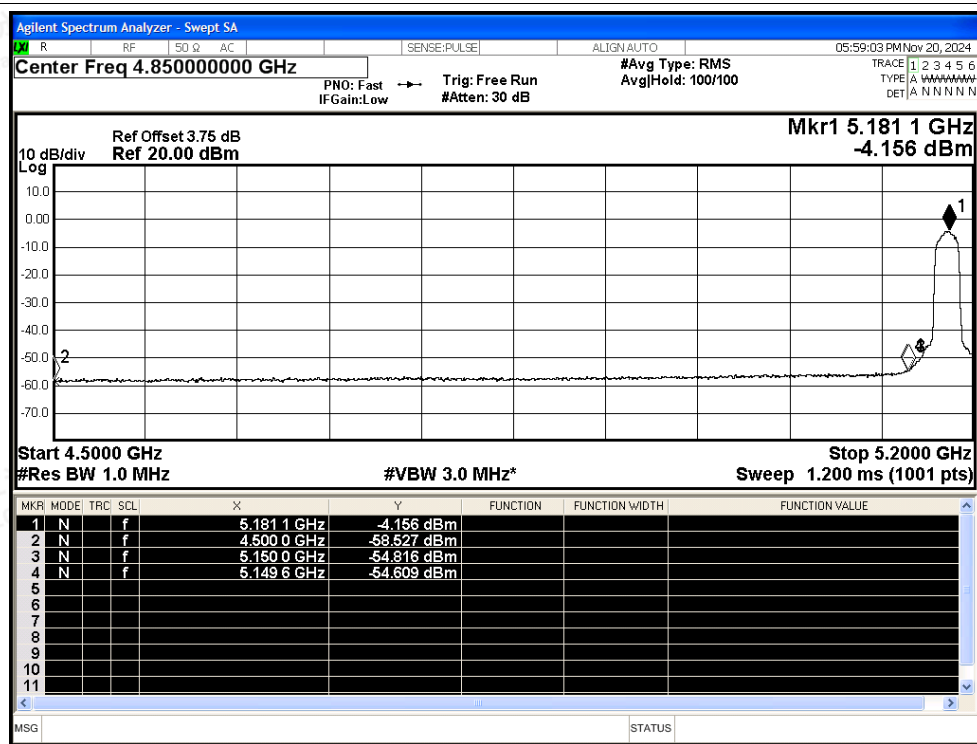

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant7 Peak

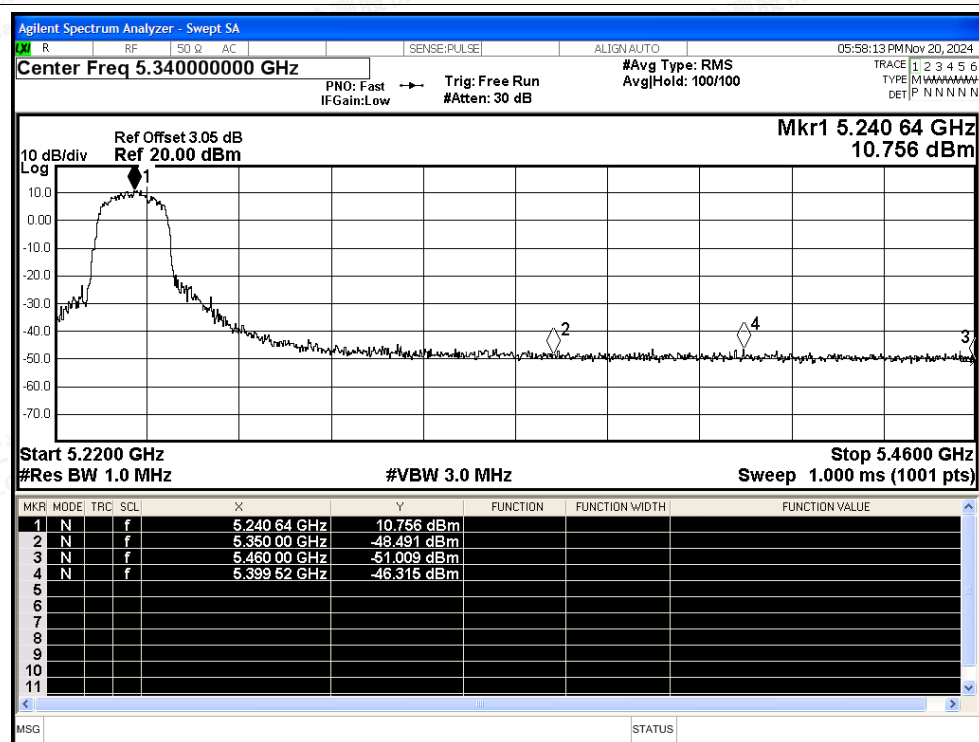

Restrict Band NVNT ac20 5240MHz Ant7 Average

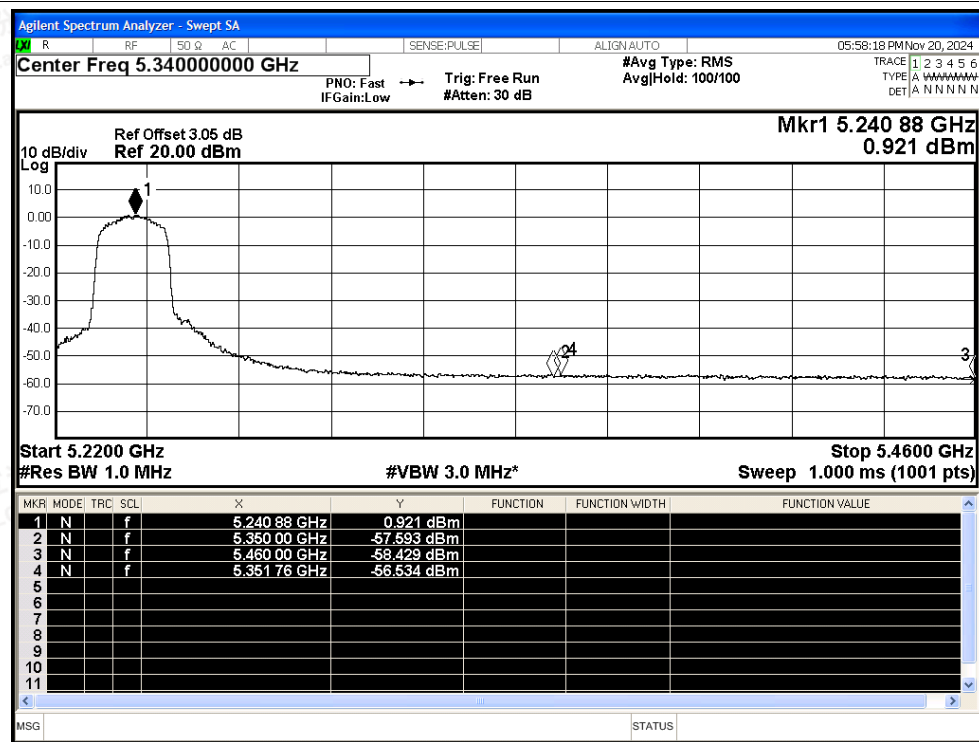

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant7 Peak

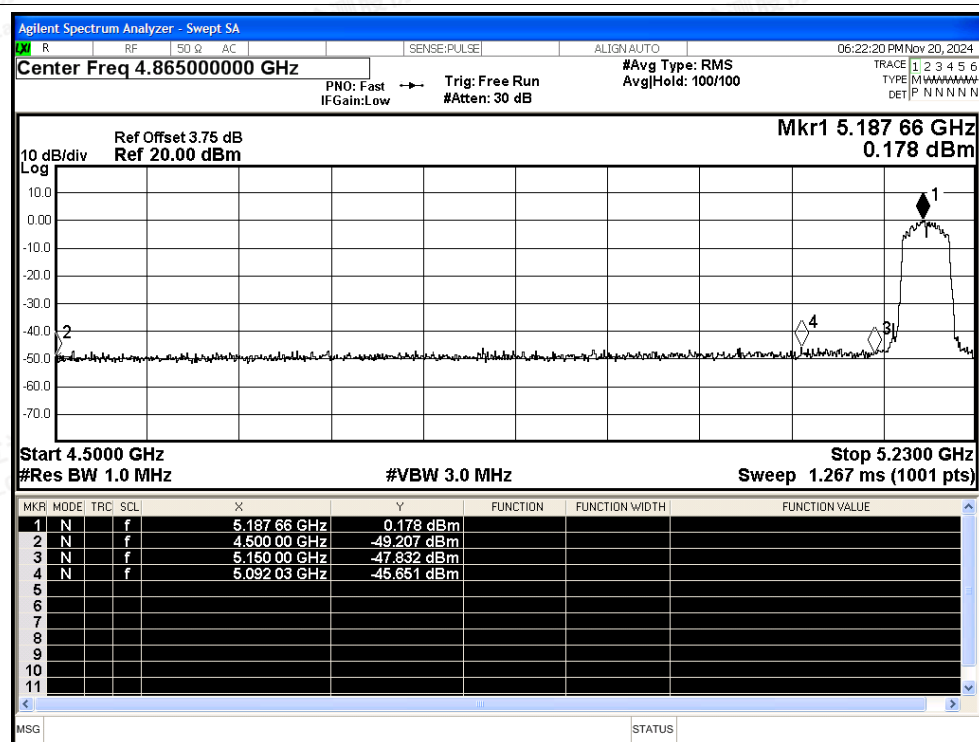

Restrict Band NVNT ac40 5190MHz Ant7 Average

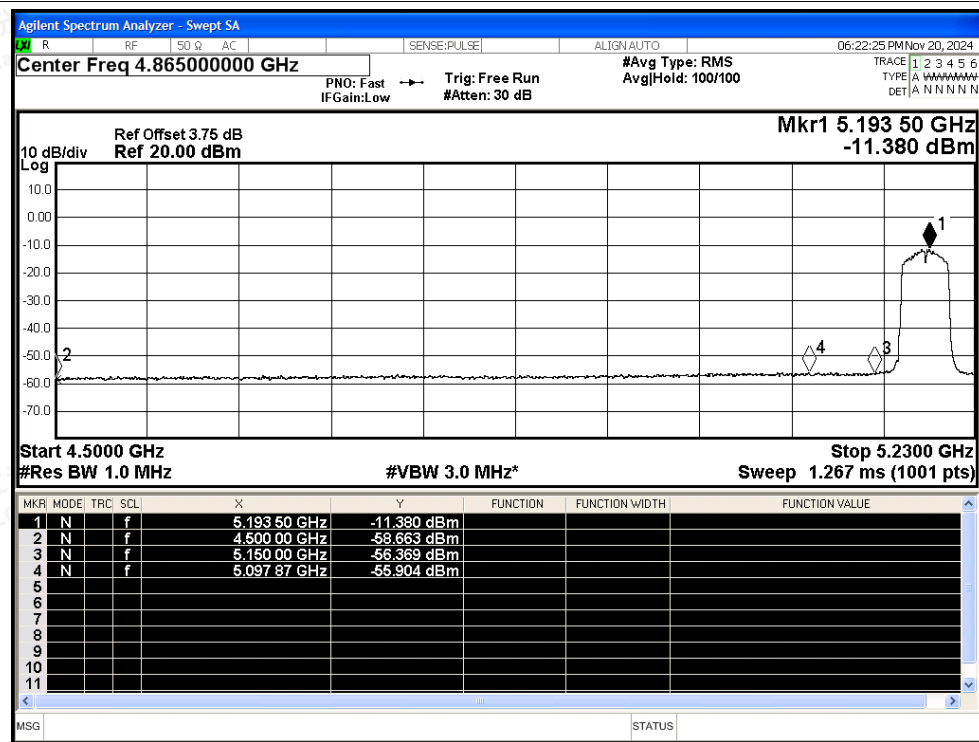

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant7 Peak

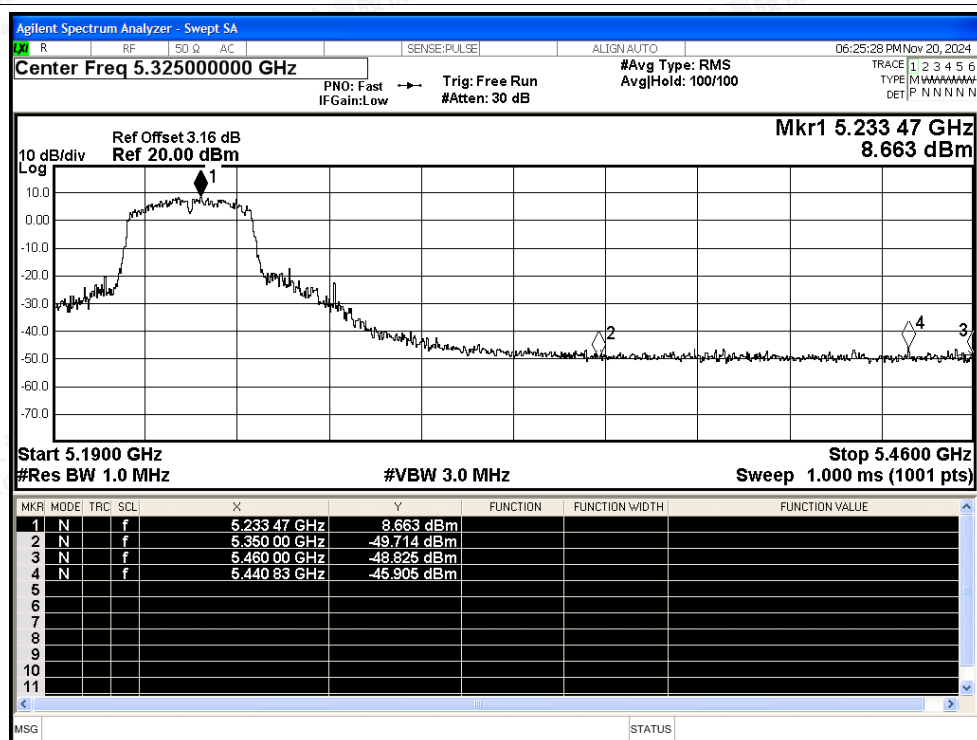

Restrict Band NVNT ac40 5230MHz Ant7 Average

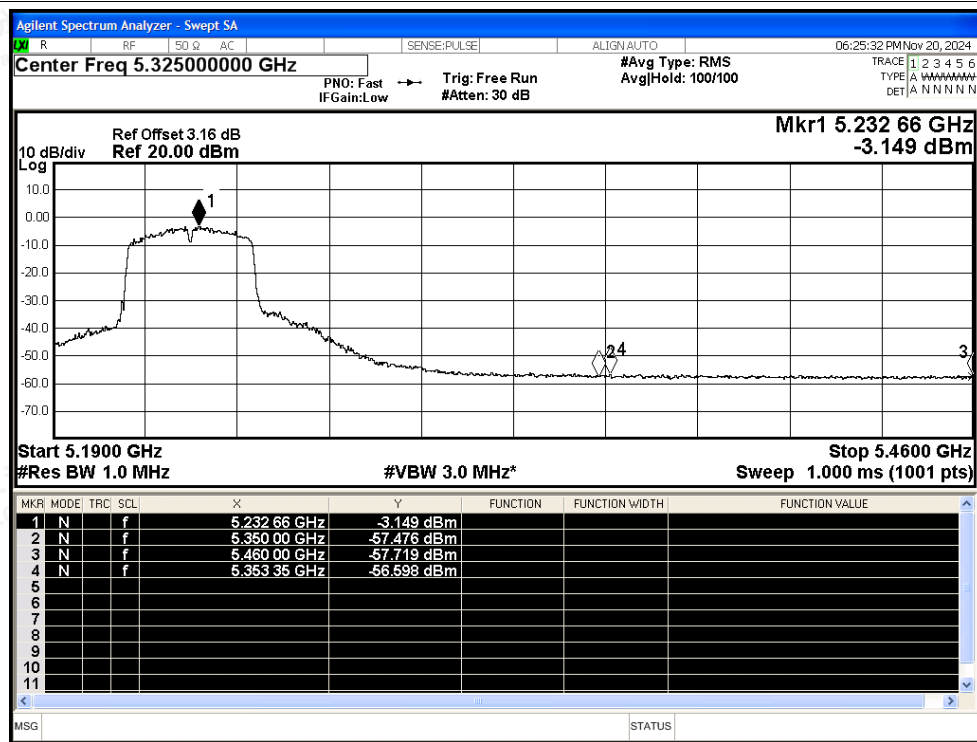

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant7 Peak

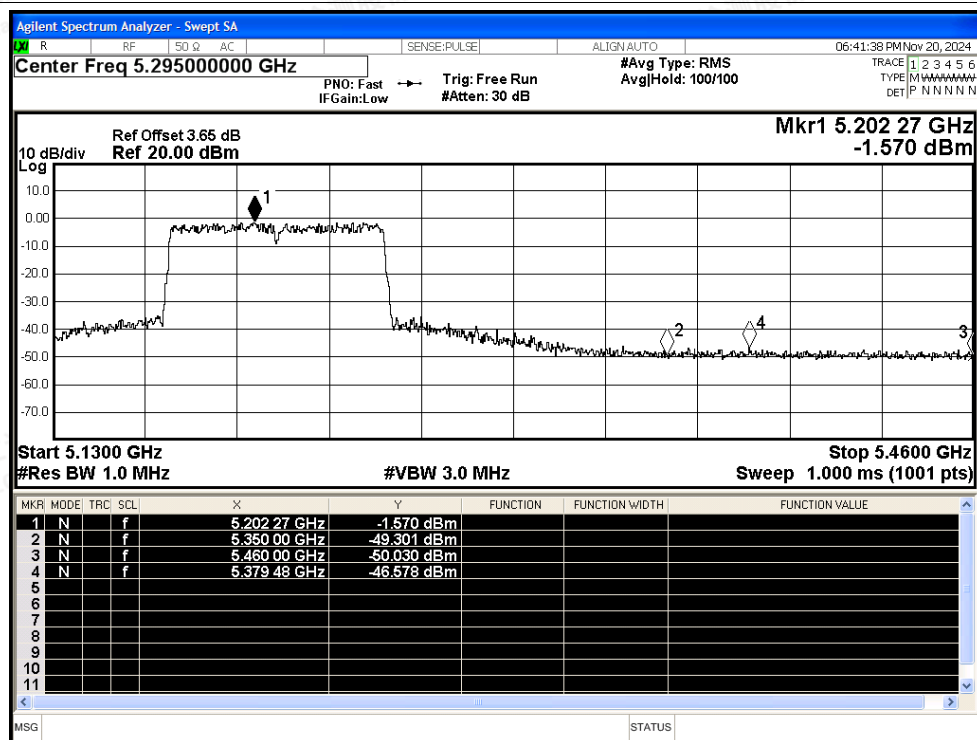

Restrict Band NVNT ac80 5210MHz Ant7 Average

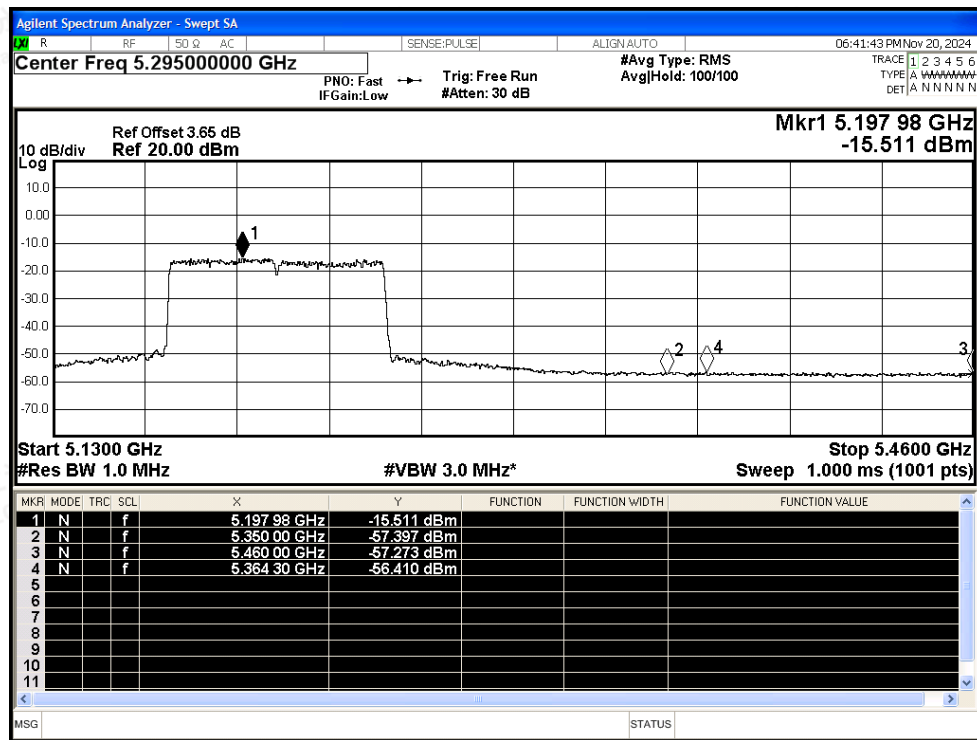

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant7 Peak

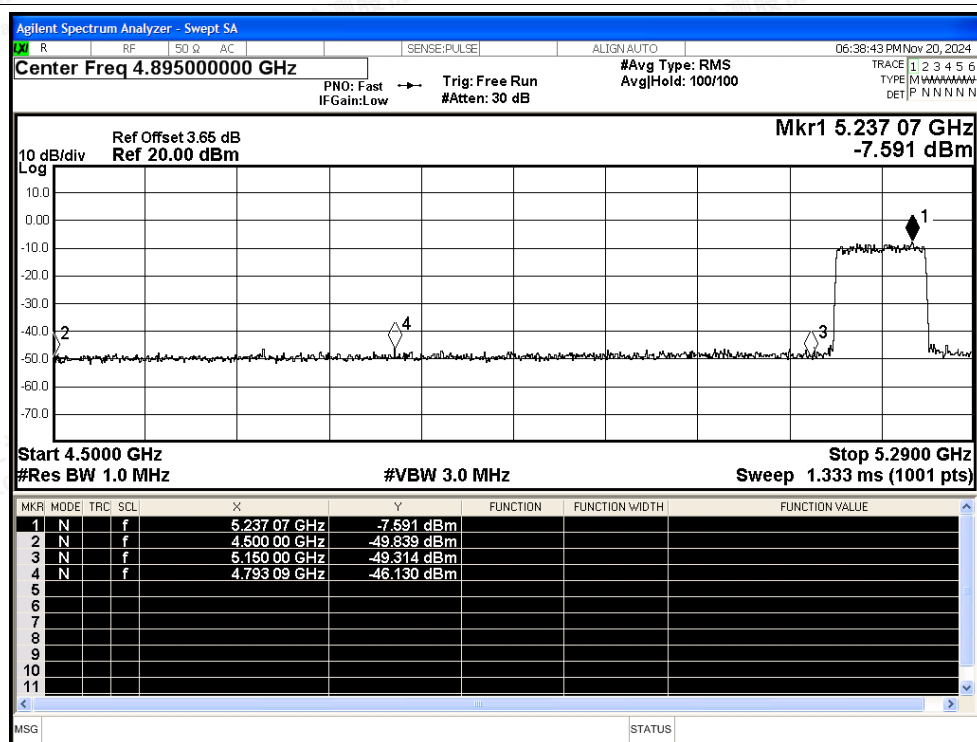

Restrict Band NVNT ac80 5210MHz Ant7 Average

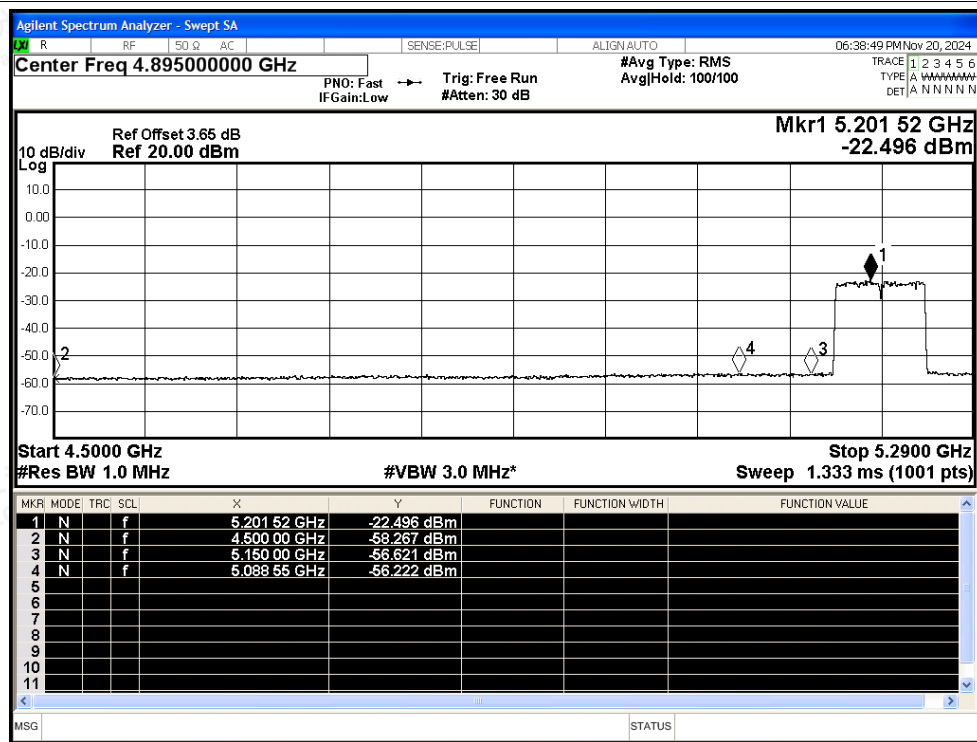

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant7 Peak

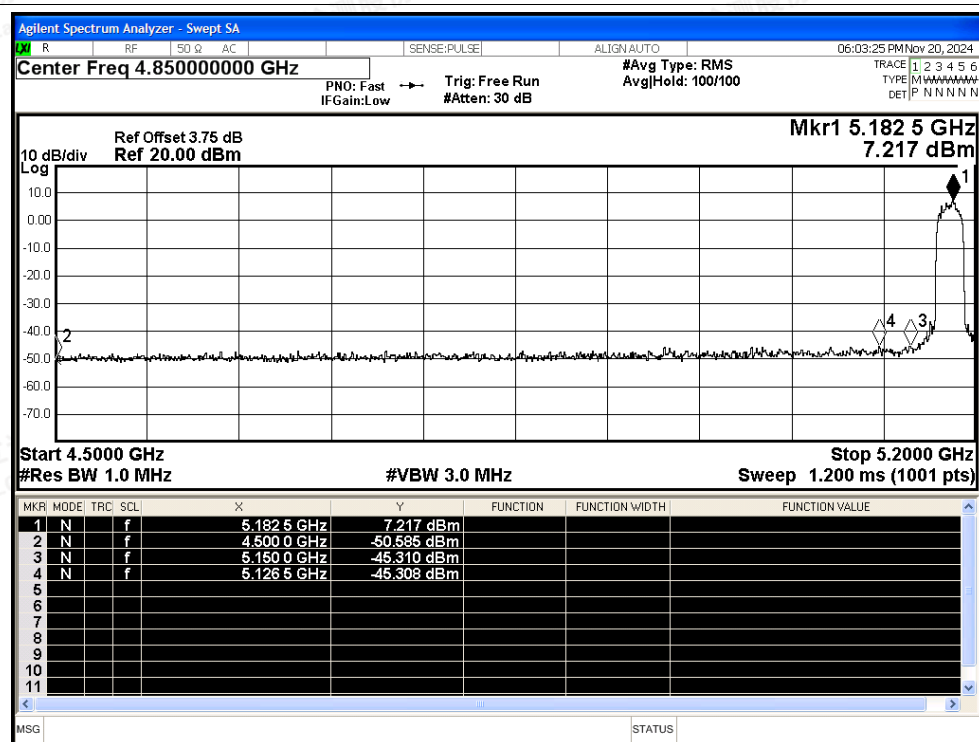

Restrict Band NVNT ax20 5180MHz Ant7 Average

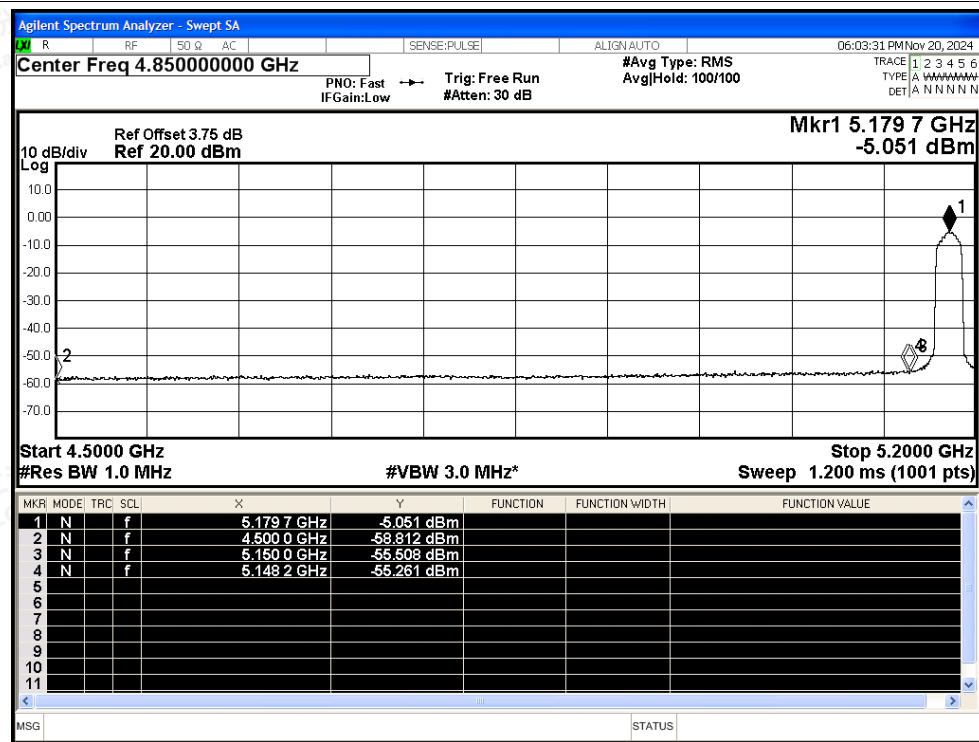

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant7 Peak

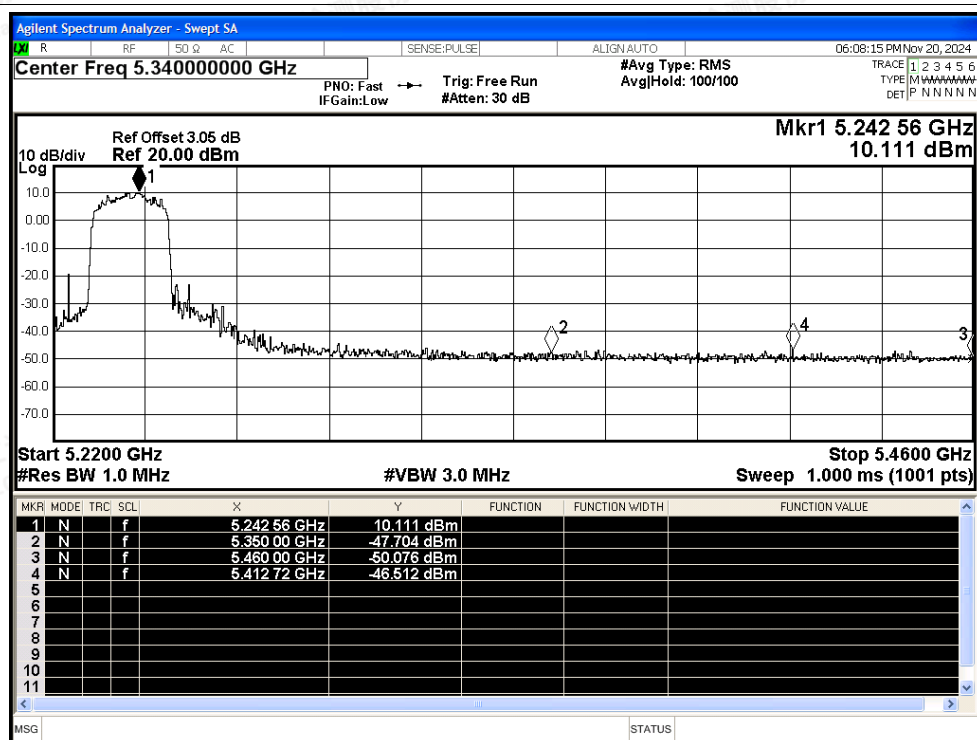

Restrict Band NVNT ax20 5240MHz Ant7 Average

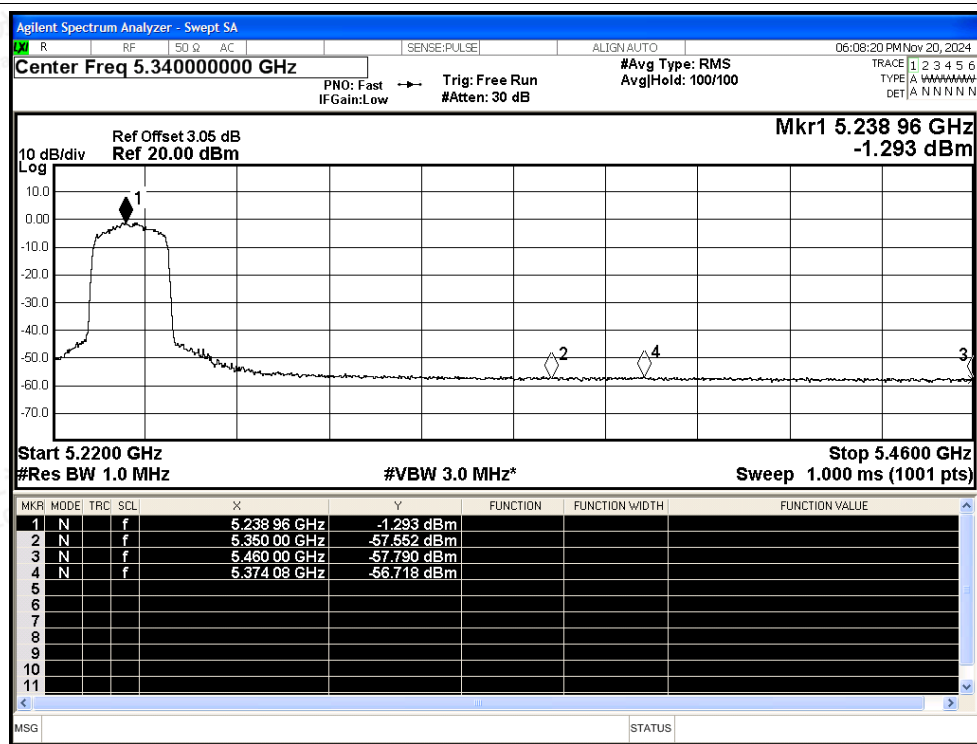

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant7 Peak

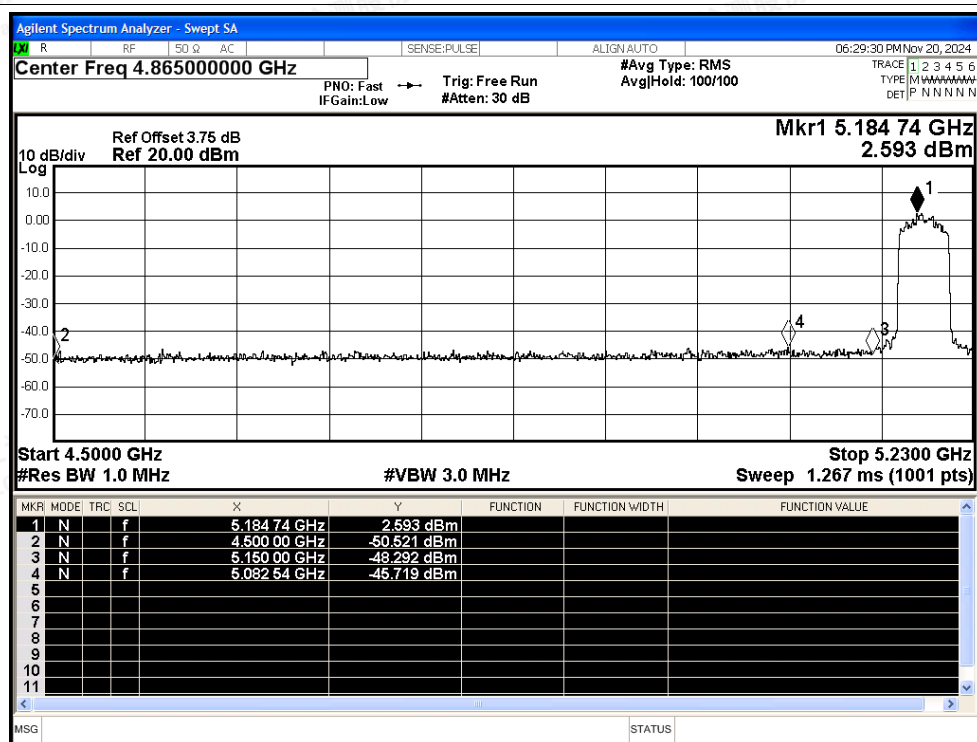

Restrict Band NVNT ax40 5190MHz Ant7 Average

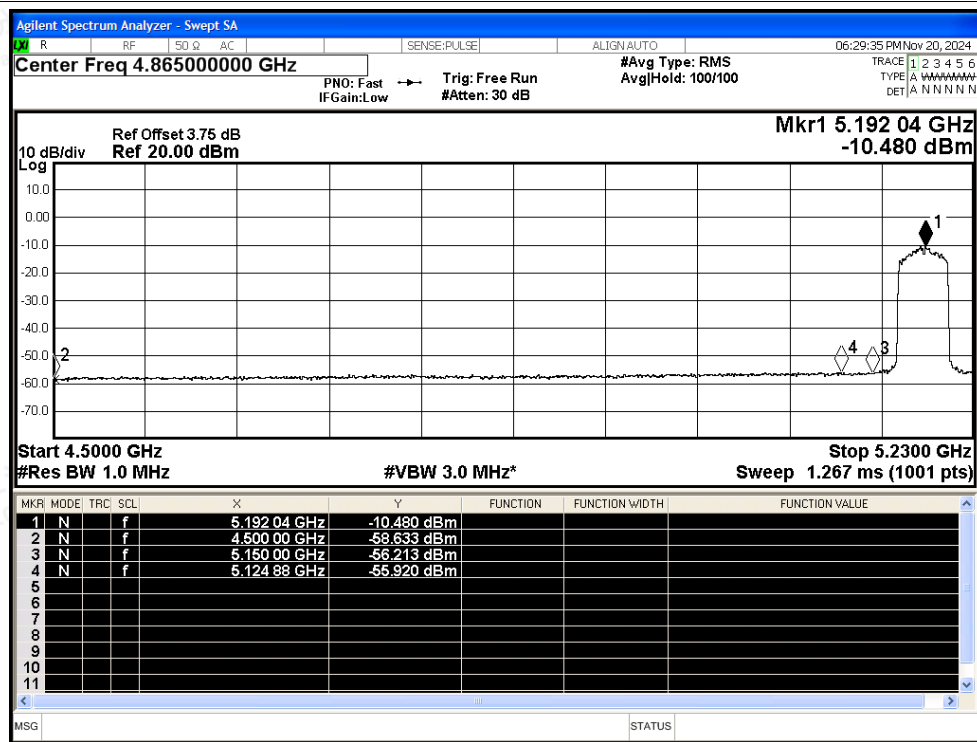

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant7 Peak



Restrict Band NVNT ax40 5230MHz Ant7 Average

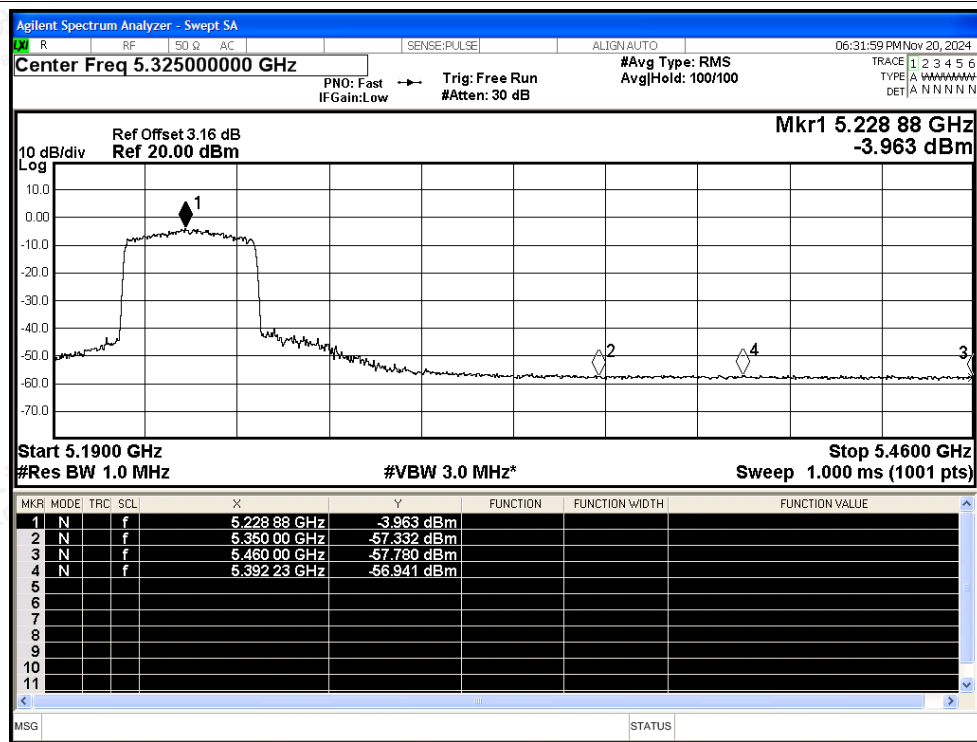

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant7 Peak

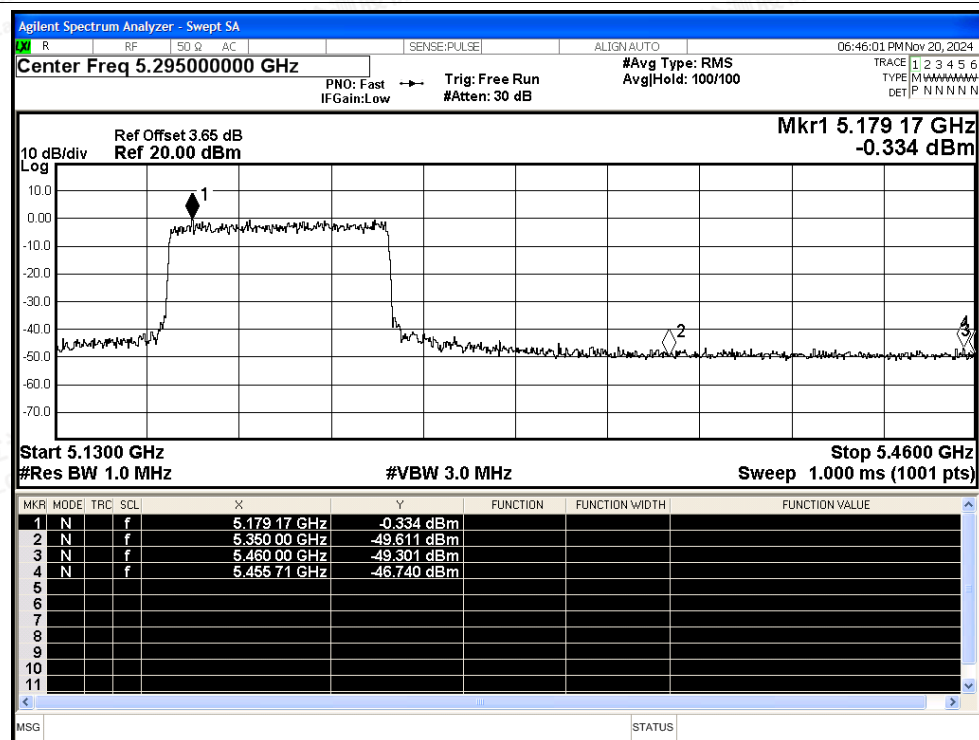

Restrict Band NVNT ax80 5210MHz Ant7 Average

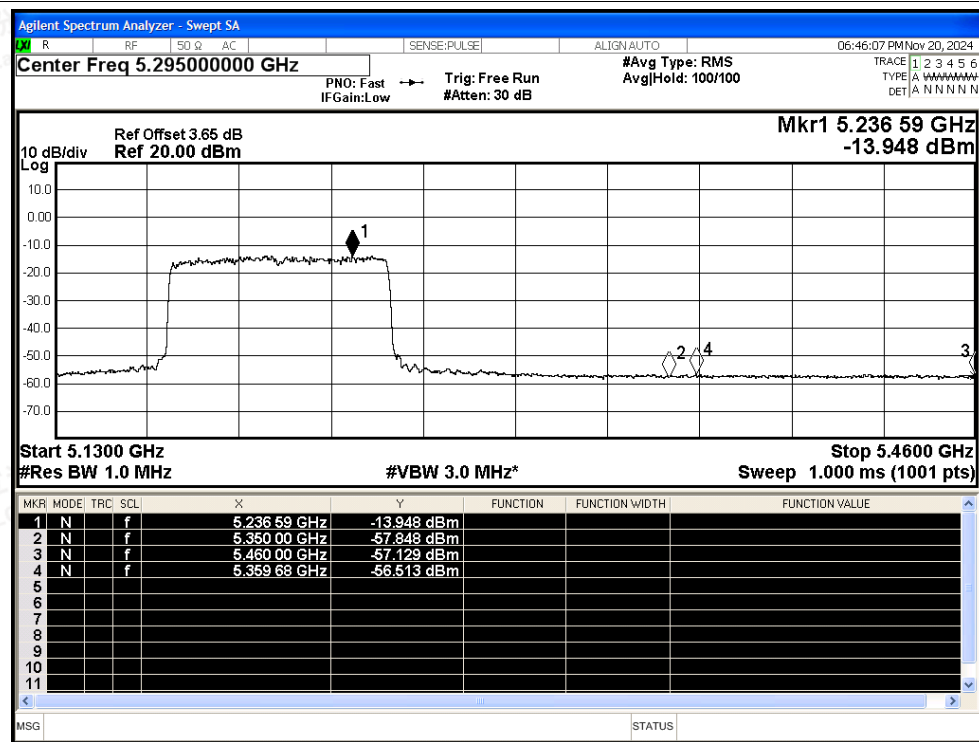

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant7 Peak

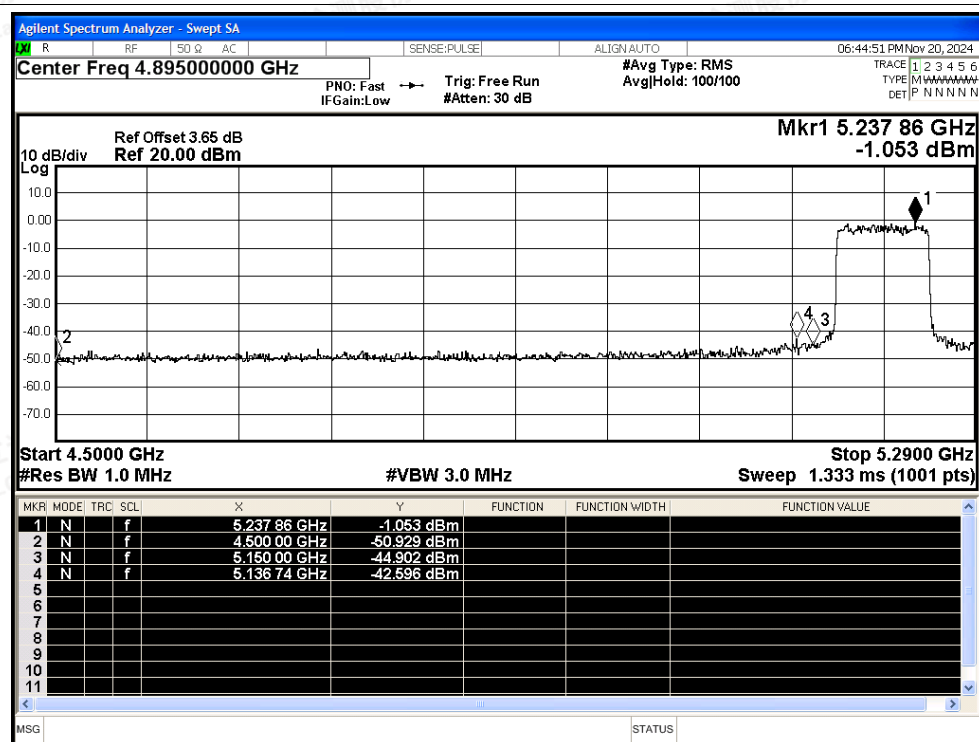

Restrict Band NVNT ax80 5210MHz Ant7 Average

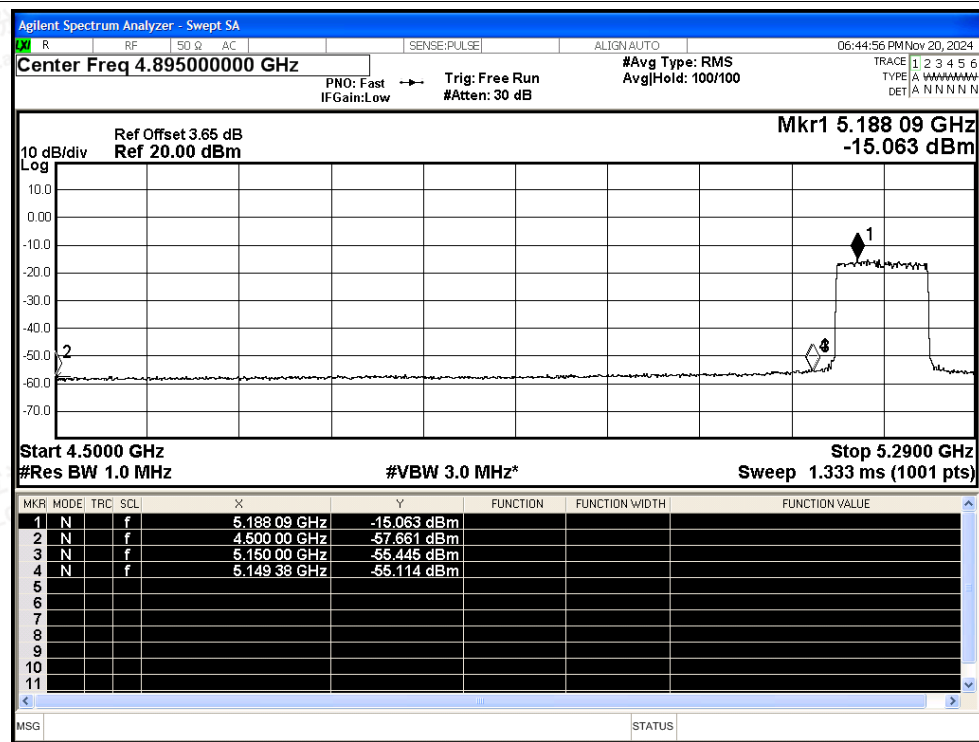

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	ANT6 Power (dBm)	ANT7 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	4500	-49.91	-51.23	2.0	49.82	Peak	68.2	Pass
NVNT	n20	5180	4500	-58.11	-58.57	2.0	42.00	Average	54	Pass
NVNT	n20	5180	5149.6	-42.31	-42.67	2.0	57.85	Peak	68.2	Pass
NVNT	n20	5180	5149.6	-54.26	-55.03	2.0	45.71	Average	54	Pass
NVNT	n20	5180	5150	-43.31	-43.67	2.0	56.85	Peak	68.2	Pass
NVNT	n20	5180	5150	-54.27	-54.35	2.0	46.03	Average	54	Pass
NVNT	n20	5240	5350	-49.09	-50.89	2.0	50.44	Peak	68.2	Pass
NVNT	n20	5240	5350	-57.33	-56.71	2.0	43.33	Average	54	Pass
NVNT	n20	5240	5359.2	-46.68	-45.91	2.0	54.06	Peak	68.2	Pass
NVNT	n20	5240	5353.92	-56.6	-56.68	2.0	43.70	Average	54	Pass
NVNT	n20	5240	5460	-49.66	-49.16	2.0	50.94	Peak	68.2	Pass
NVNT	n20	5240	5460	-57.58	-58.06	2.0	42.52	Average	54	Pass
NVNT	n40	5190	4500	-50.15	-50.03	2.0	50.25	Peak	68.2	Pass
NVNT	n40	5190	4500	-58	-57.7	2.0	42.49	Average	54	Pass
NVNT	n40	5190	5067.21	-46.11	-46.07	2.0	54.25	Peak	68.2	Pass
NVNT	n40	5190	5149.7	-55.97	-56.08	2.0	44.31	Average	54	Pass
NVNT	n40	5190	5150	-49.19	-46.47	2.0	52.72	Peak	68.2	Pass
NVNT	n40	5190	5150	-55.97	-56.89	2.0	43.93	Average	54	Pass
NVNT	n40	5230	5350	-49.52	-48.07	2.0	51.60	Peak	68.2	Pass
NVNT	n40	5230	5350	-57.51	-57.83	2.0	42.67	Average	54	Pass
NVNT	n40	5230	5424.9	-45.92	-46.33	2.0	54.22	Peak	68.2	Pass
NVNT	n40	5230	5357.13	-56.44	-56.8	2.0	43.72	Average	54	Pass
NVNT	n40	5230	5460	-50.37	-49.77	2.0	50.28	Peak	68.2	Pass
NVNT	n40	5230	5460	-57.65	-57.47	2.0	42.78	Average	54	Pass
NVNT	ac20	5180	4500	-51.01	-48.39	2.0	50.83	Peak	68.2	Pass
NVNT	ac20	5180	4500	-58.49	-58.53	2.0	41.83	Average	54	Pass
NVNT	ac20	5180	5145.4	-43.67	-44.11	2.0	56.45	Peak	68.2	Pass
NVNT	ac20	5180	5148.2	-54.11	-54.61	2.0	45.99	Average	54	Pass
NVNT	ac20	5180	5150	-42.72	-43.96	2.0	57.04	Peak	68.2	Pass
NVNT	ac20	5180	5150	-52.61	-54.82	2.0	46.76	Average	54	Pass
NVNT	ac20	5240	5350	-48.09	-48.49	2.0	52.05	Peak	68.2	Pass
NVNT	ac20	5240	5350	-57.68	-57.59	2.0	42.70	Average	54	Pass
NVNT	ac20	5240	5381.04	-46.74	-46.32	2.0	53.81	Peak	68.2	Pass
NVNT	ac20	5240	5362.8	-56.52	-56.53	2.0	43.81	Average	54	Pass
NVNT	ac20	5240	5460	-49.42	-51.01	2.0	50.20	Peak	68.2	Pass
NVNT	ac20	5240	5460	-58.22	-58.43	2.0	42.01	Average	54	Pass
NVNT	ac40	5190	4500	-49.57	-49.21	2.0	50.95	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	4500	-58.11	-58.66	2.0	41.96	Average	54	Pass
NVNT	ac40	5190	5143.13	-39.69	-45.65	2.0	58.62	Peak	68.2	Pass
NVNT	ac40	5190	5149.7	-50.35	-55.9	2.0	48.04	Average	54	Pass
NVNT	ac40	5190	5150	-41.15	-47.83	2.0	57.02	Peak	68.2	Pass
NVNT	ac40	5190	5150	-50.35	-56.37	2.0	47.95	Average	54	Pass
NVNT	ac40	5230	5350	-50.24	-49.71	2.0	50.37	Peak	68.2	Pass
NVNT	ac40	5230	5350	-57.71	-57.48	2.0	42.74	Average	54	Pass
NVNT	ac40	5230	5364.96	-46.41	-45.91	2.0	54.19	Peak	68.2	Pass
NVNT	ac40	5230	5363.61	-56.89	-56.6	2.0	43.60	Average	54	Pass
NVNT	ac40	5230	5460	-51.31	-48.83	2.0	50.44	Peak	68.2	Pass
NVNT	ac40	5230	5460	-57.88	-57.72	2.0	42.54	Average	54	Pass
NVNT	ac80	5210	5350	-49.6	-49.3	2.0	50.89	Peak	68.2	Pass
NVNT	ac80	5210	5350	-57.55	-57.4	2.0	42.86	Average	54	Pass
NVNT	ac80	5210	5422.05	-46.66	-46.58	2.0	53.72	Peak	68.2	Pass
NVNT	ac80	5210	5374.2	-56.73	-56.41	2.0	43.77	Average	54	Pass
NVNT	ac80	5210	5460	-50.72	-50.03	2.0	49.98	Peak	68.2	Pass
NVNT	ac80	5210	5460	-58.03	-57.27	2.0	42.70	Average	54	Pass
NVNT	ac80	5210	4500	-50.8	-49.84	2.0	50.04	Peak	68.2	Pass
NVNT	ac80	5210	4500	-58.3	-58.27	2.0	42.05	Average	54	Pass
NVNT	ac80	5210	5147.8	-45.21	-46.13	2.0	54.69	Peak	68.2	Pass
NVNT	ac80	5210	5093.29	-55.98	-56.22	2.0	44.24	Average	54	Pass
NVNT	ac80	5210	5150	-46.13	-49.31	2.0	52.90	Peak	68.2	Pass
NVNT	ac80	5210	5150	-56.26	-56.62	2.0	43.90	Average	54	Pass
NVNT	ax20	5180	4500	-49.87	-50.59	2.0	50.12	Peak	68.2	Pass
NVNT	ax20	5180	4500	-58.26	-58.81	2.0	41.81	Average	54	Pass
NVNT	ax20	5180	5077.5	-45.36	-45.31	2.0	55.00	Peak	68.2	Pass
NVNT	ax20	5180	5147.5	-55.35	-55.26	2.0	45.03	Average	54	Pass
NVNT	ax20	5180	5150	-45.68	-45.31	2.0	54.85	Peak	68.2	Pass
NVNT	ax20	5180	5150	-55.79	-55.51	2.0	44.69	Average	54	Pass
NVNT	ax20	5240	5350	-50.03	-47.7	2.0	51.63	Peak	68.2	Pass
NVNT	ax20	5240	5350	-57.47	-57.55	2.0	42.83	Average	54	Pass
NVNT	ax20	5240	5366.4	-46.26	-46.51	2.0	53.95	Peak	68.2	Pass
NVNT	ax20	5240	5367.84	-56.32	-56.72	2.0	43.82	Average	54	Pass
NVNT	ax20	5240	5460	-49.44	-50.08	2.0	50.59	Peak	68.2	Pass
NVNT	ax20	5240	5460	-57.63	-57.79	2.0	42.63	Average	54	Pass
NVNT	ax40	5190	4500	-49.59	-50.52	2.0	50.31	Peak	68.2	Pass
NVNT	ax40	5190	4500	-58.26	-58.63	2.0	41.90	Average	54	Pass
NVNT	ax40	5190	5121.23	-44.23	-45.72	2.0	55.43	Peak	68.2	Pass
NVNT	ax40	5190	5147.51	-54.81	-55.92	2.0	45.01	Average	54	Pass
NVNT	ax40	5190	5150	-45.22	-48.29	2.0	53.85	Peak	68.2	Pass
NVNT	ax40	5190	5150	-54.98	-56.21	2.0	44.79	Average	54	Pass
NVNT	ax40	5230	5350	-49.09	-48.29	2.0	51.67	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	5350	-56.86	-57.33	2.0	43.25	Average	54	Pass
NVNT	ax40	5230	5397.09	-46.05	-45.84	2.0	54.39	Peak	68.2	Pass
NVNT	ax40	5230	5363.88	-56.54	-56.94	2.0	43.60	Average	54	Pass
NVNT	ax40	5230	5460	-48.93	-49.5	2.0	51.13	Peak	68.2	Pass
NVNT	ax40	5230	5460	-57.91	-57.78	2.0	42.49	Average	54	Pass
NVNT	ax80	5210	5350	-49.01	-49.61	2.0	51.04	Peak	68.2	Pass
NVNT	ax80	5210	5350	-57.44	-57.85	2.0	42.70	Average	54	Pass
NVNT	ax80	5210	5356.71	-46.63	-46.74	2.0	53.65	Peak	68.2	Pass
NVNT	ax80	5210	5444.49	-56.66	-56.51	2.0	43.75	Average	54	Pass
NVNT	ax80	5210	5460	-49.39	-49.3	2.0	50.99	Peak	68.2	Pass
NVNT	ax80	5210	5460	-57.92	-57.13	2.0	42.83	Average	54	Pass
NVNT	ax80	5210	4500	-49.92	-50.93	2.0	49.94	Peak	68.2	Pass
NVNT	ax80	5210	4500	-58.34	-57.66	2.0	42.35	Average	54	Pass
NVNT	ax80	5210	5149.38	-45.58	-42.6	2.0	56.50	Peak	68.2	Pass
NVNT	ax80	5210	5143.06	-55.93	-55.11	2.0	44.84	Average	54	Pass
NVNT	ax80	5210	5150	-46.78	-44.9	2.0	54.60	Peak	68.2	Pass
NVNT	ax80	5210	5150	-56.17	-55.45	2.0	44.54	Average	54	Pass





D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant6	5180	0	0	25	Pass
NVNT	a	5200	Ant6	5200	0	0	25	Pass
NVNT	a	5240	Ant6	5239.96	-40000	-7.63	25	Pass
NVNT	n20	5180	Ant6	5180	0	0	25	Pass
NVNT	n20	5200	Ant6	5199.94	-60000	-11.54	25	Pass
NVNT	n20	5240	Ant6	5240	0	0	25	Pass
NVNT	n40	5190	Ant6	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant6	5230	0	0	25	Pass
NVNT	ac20	5180	Ant6	5180	0	0	25	Pass
NVNT	ac20	5200	Ant6	5200.02	20000	3.85	25	Pass
NVNT	ac20	5240	Ant6	5240.02	20000	3.82	25	Pass
NVNT	ac40	5190	Ant6	5190.04	40000	7.71	25	Pass
NVNT	ac40	5230	Ant6	5230	0	0	25	Pass
NVNT	ac80	5210	Ant6	5210	0	0	25	Pass
NVNT	ax20	5180	Ant6	5180	0	0	25	Pass
NVNT	ax20	5200	Ant6	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant6	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant6	5189.96	-40000	-7.71	25	Pass
NVNT	ax40	5230	Ant6	5230	0	0	25	Pass
NVNT	ax80	5210	Ant6	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant6

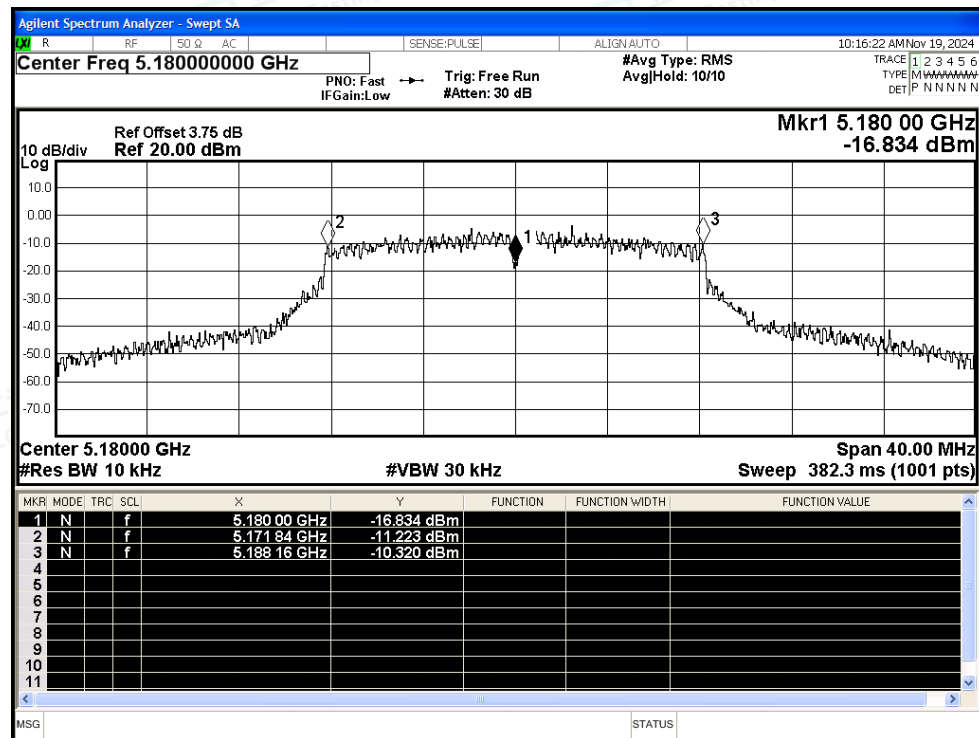

Freq. Stability NVNT a 5200MHz Ant6

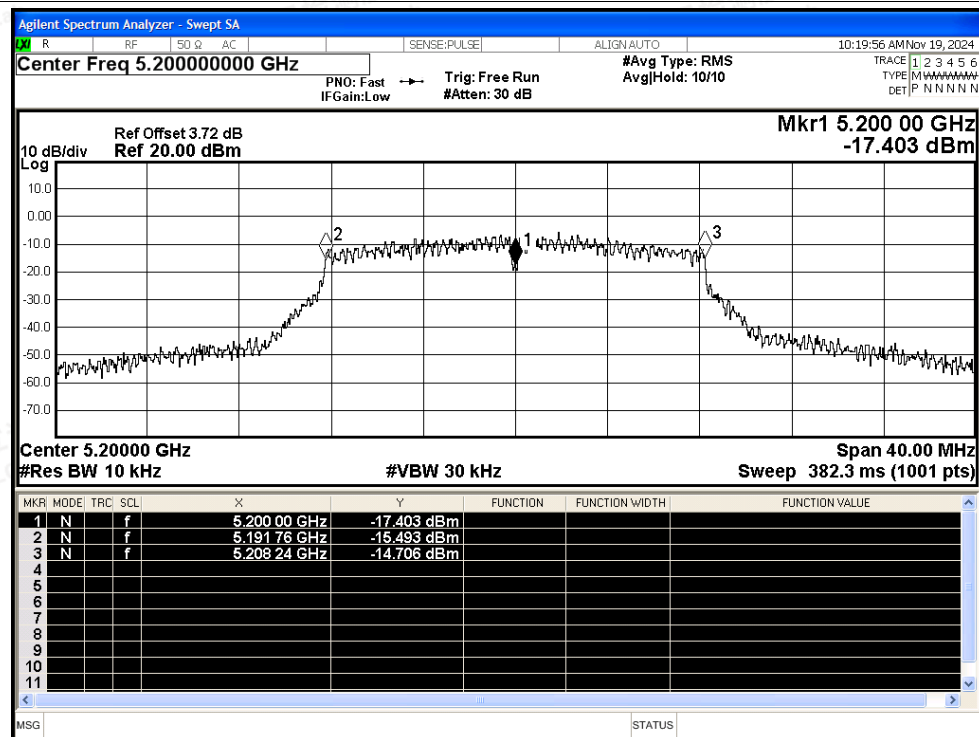

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant6

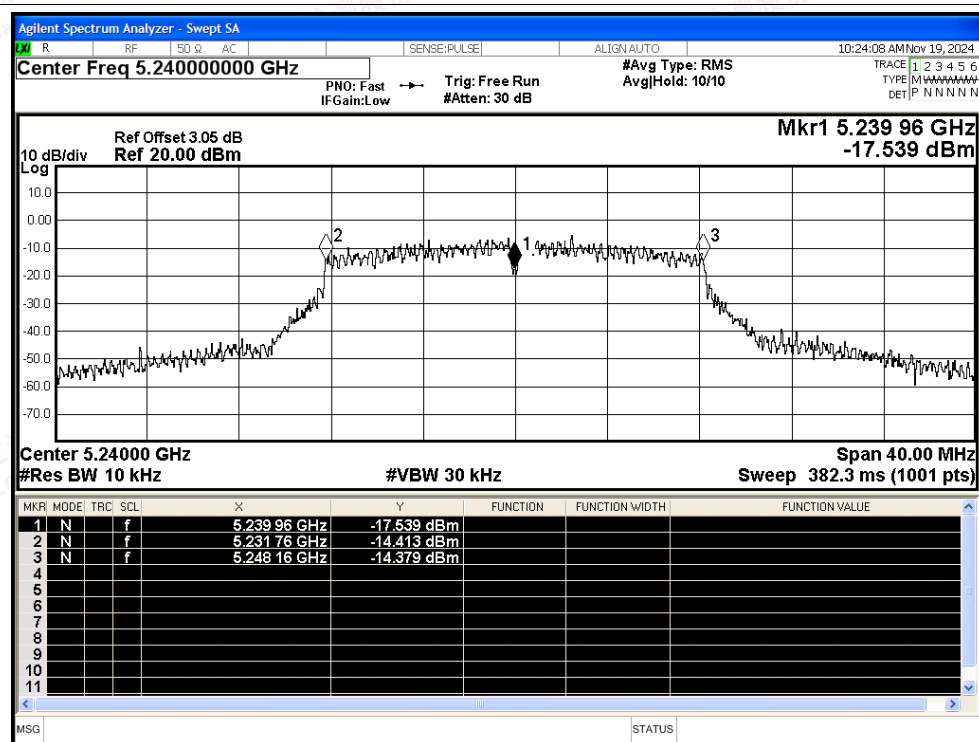

Freq. Stability NVNT n20 5180MHz Ant6

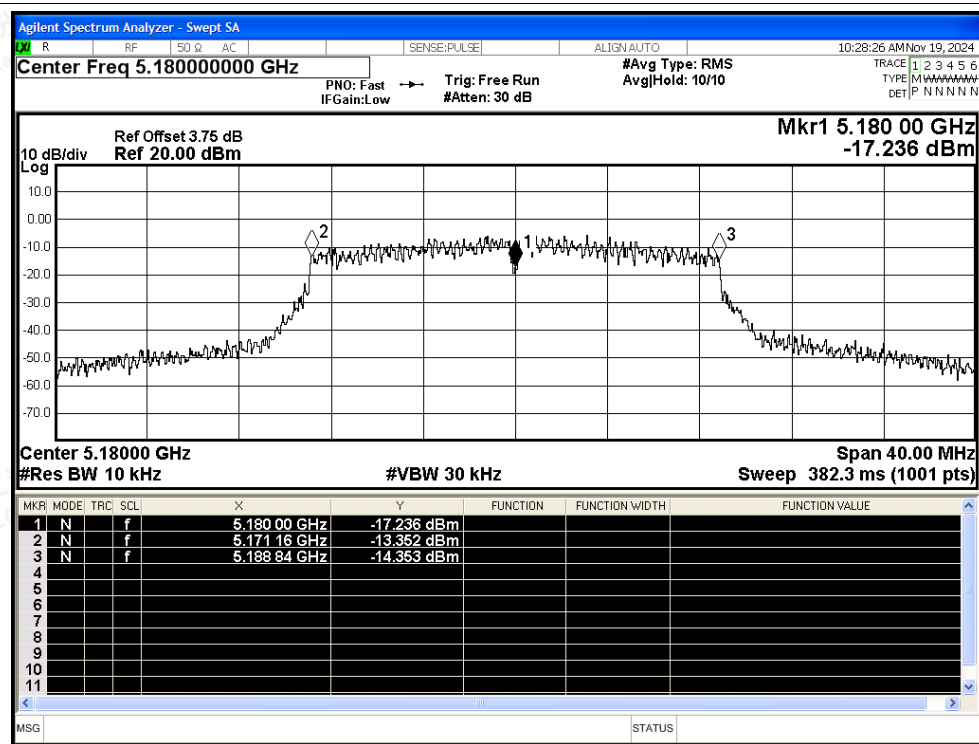

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant6

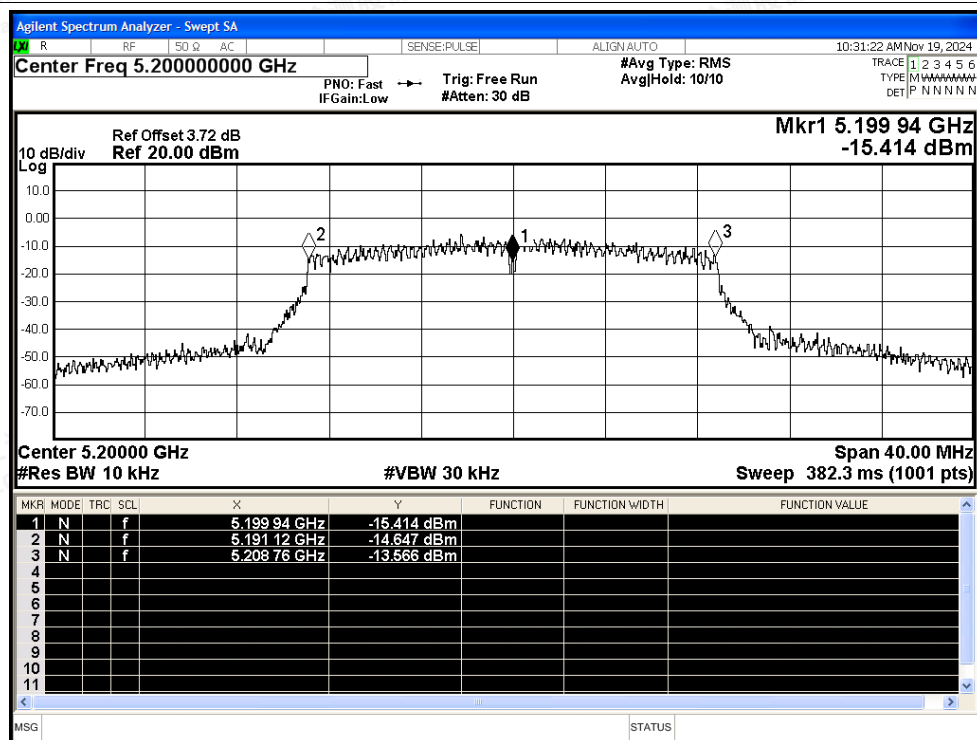

Freq. Stability NVNT n20 5240MHz Ant6

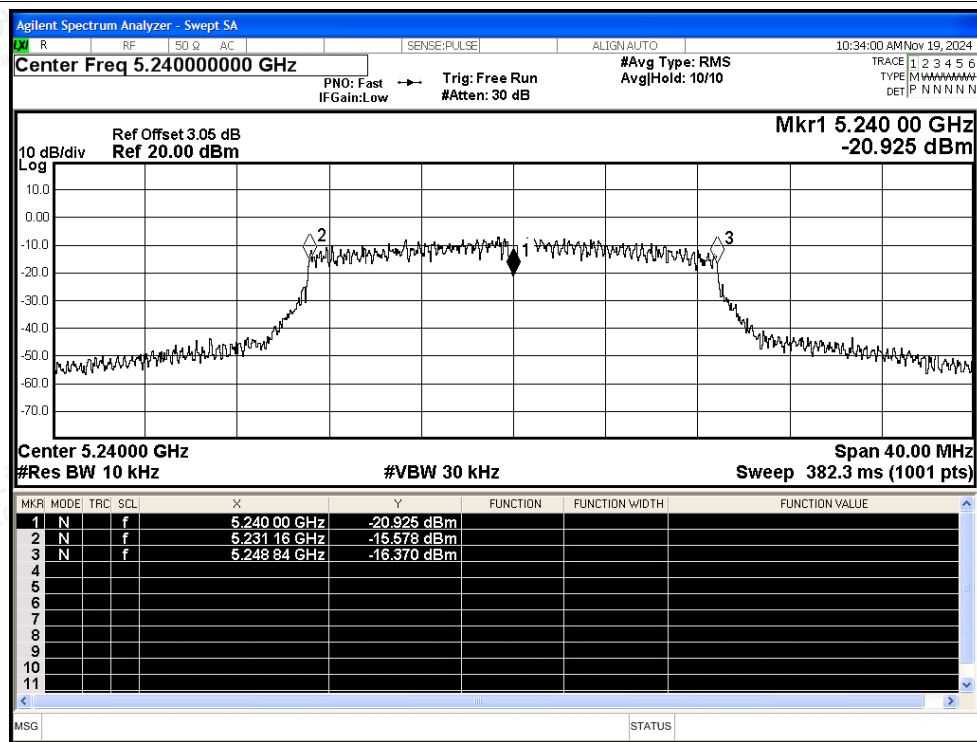

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant6

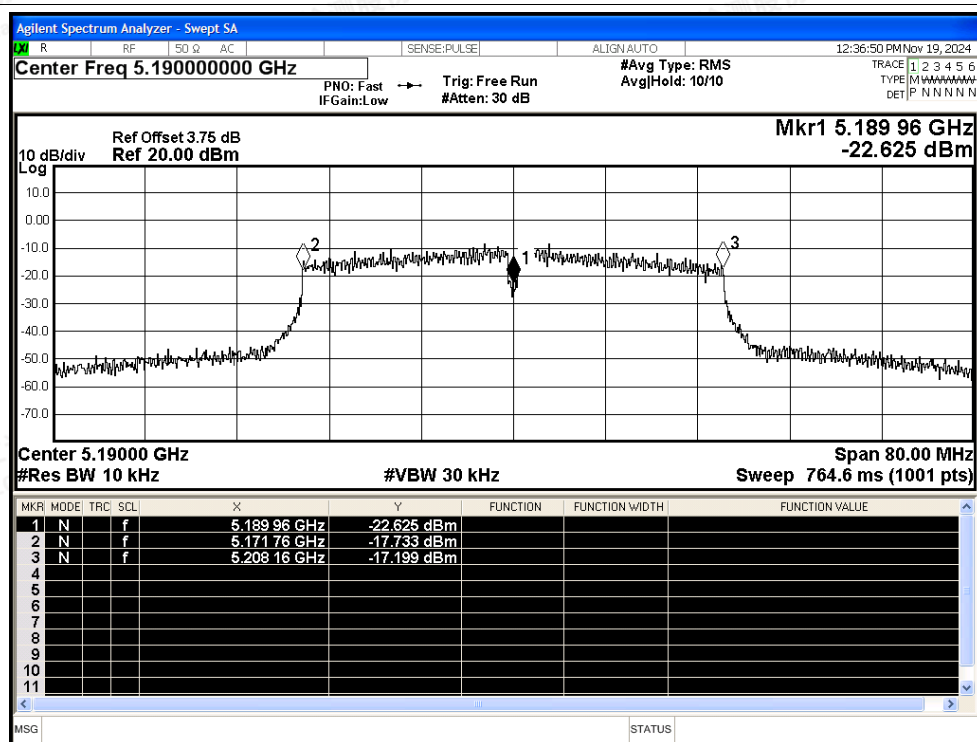

Freq. Stability NVNT n40 5230MHz Ant6


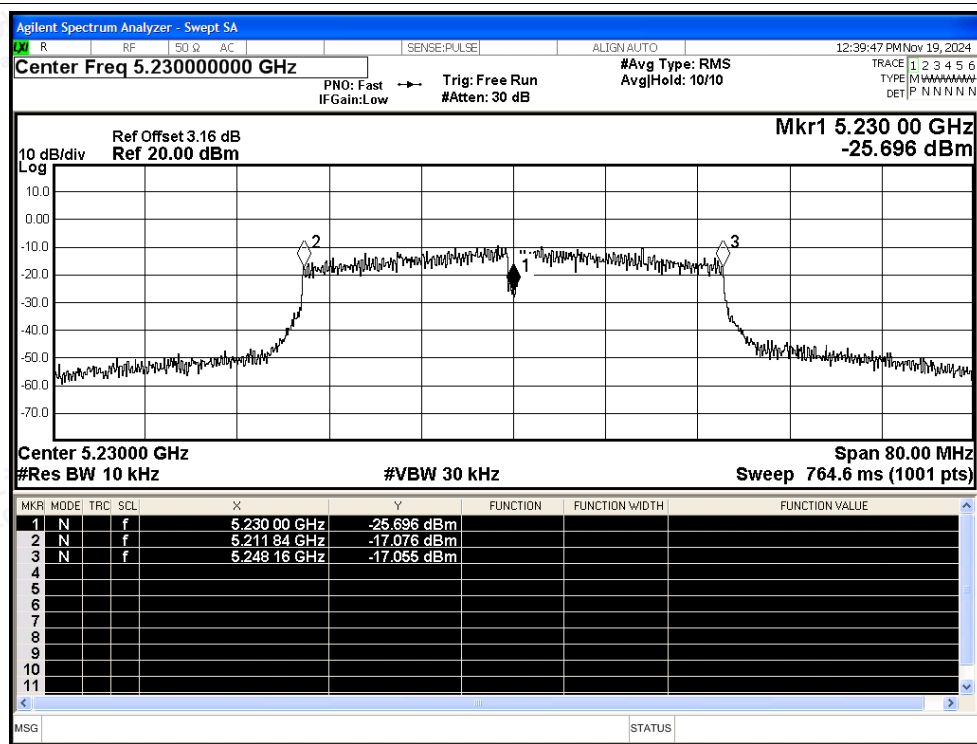


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

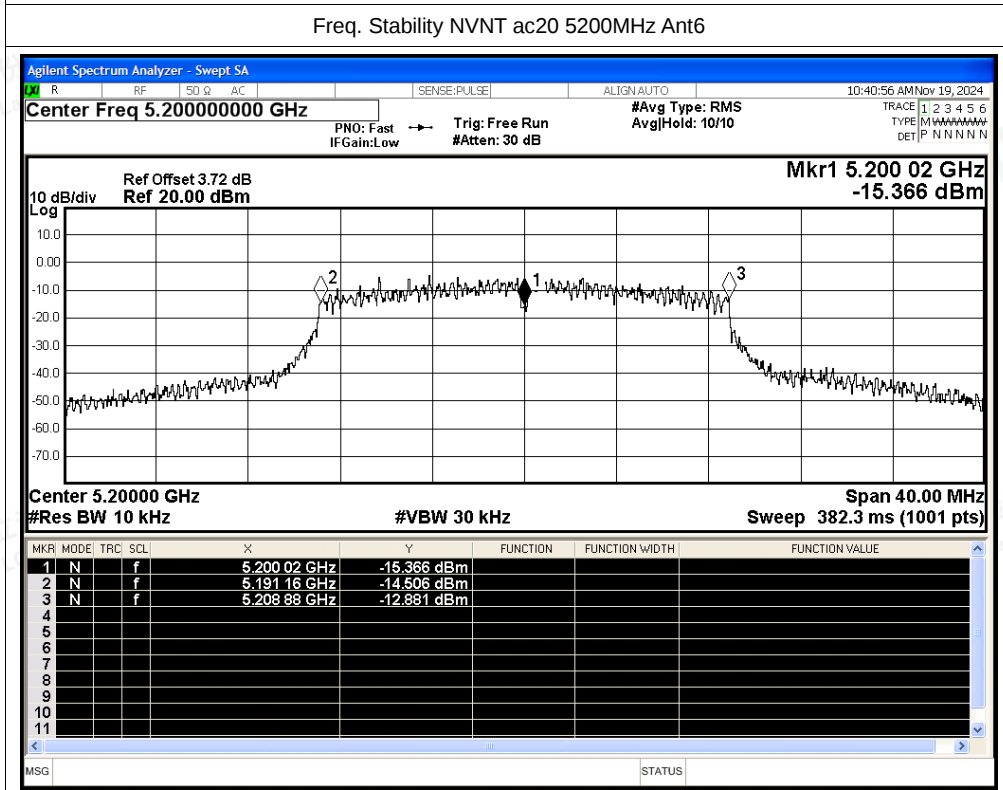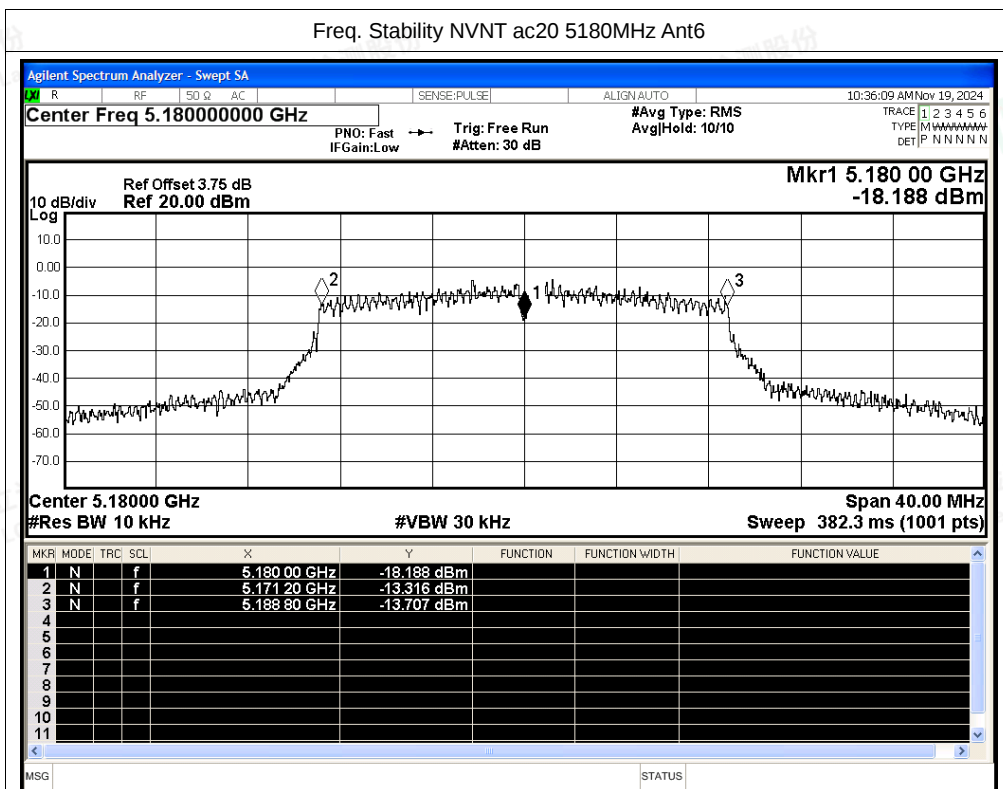

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant6

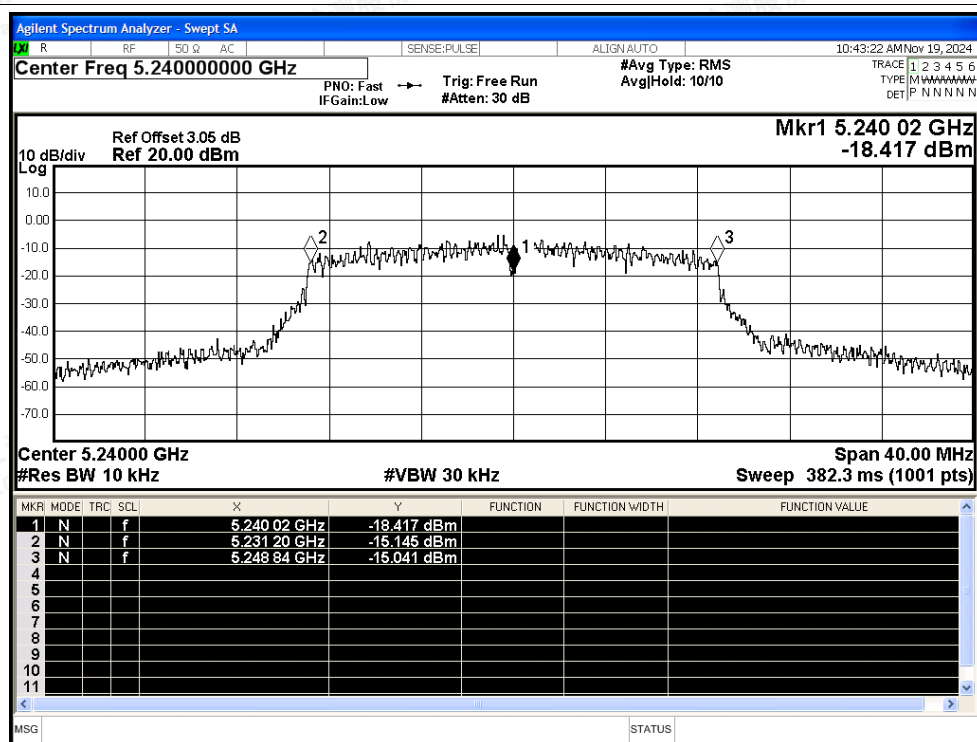

Freq. Stability NVNT ac40 5190MHz Ant6

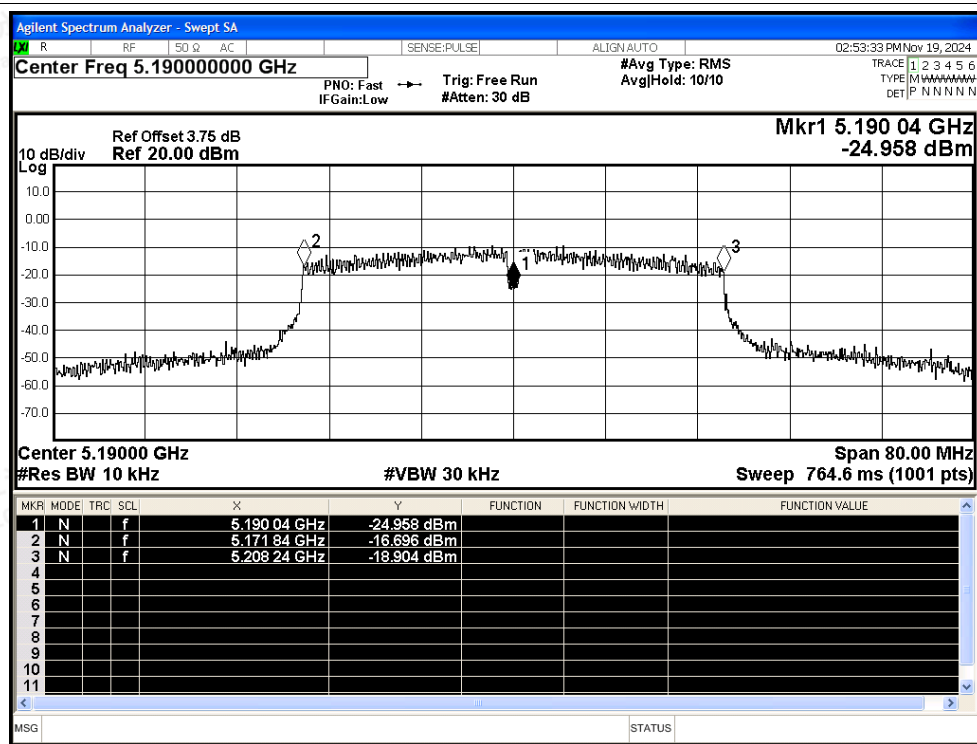

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant6

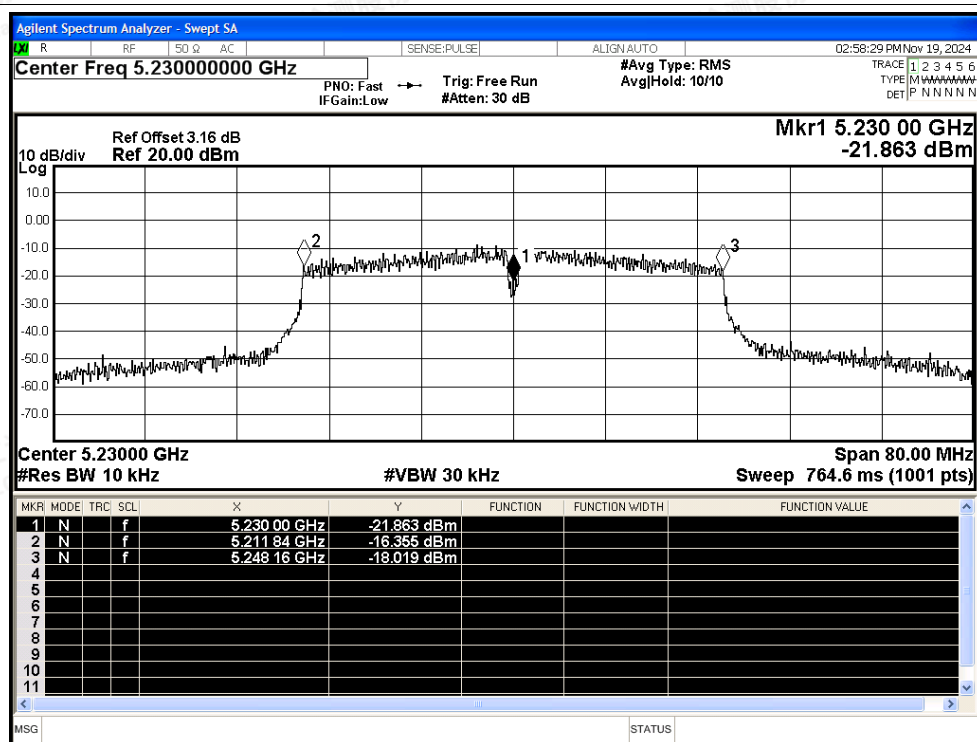

Freq. Stability NVNT ac80 5210MHz Ant6

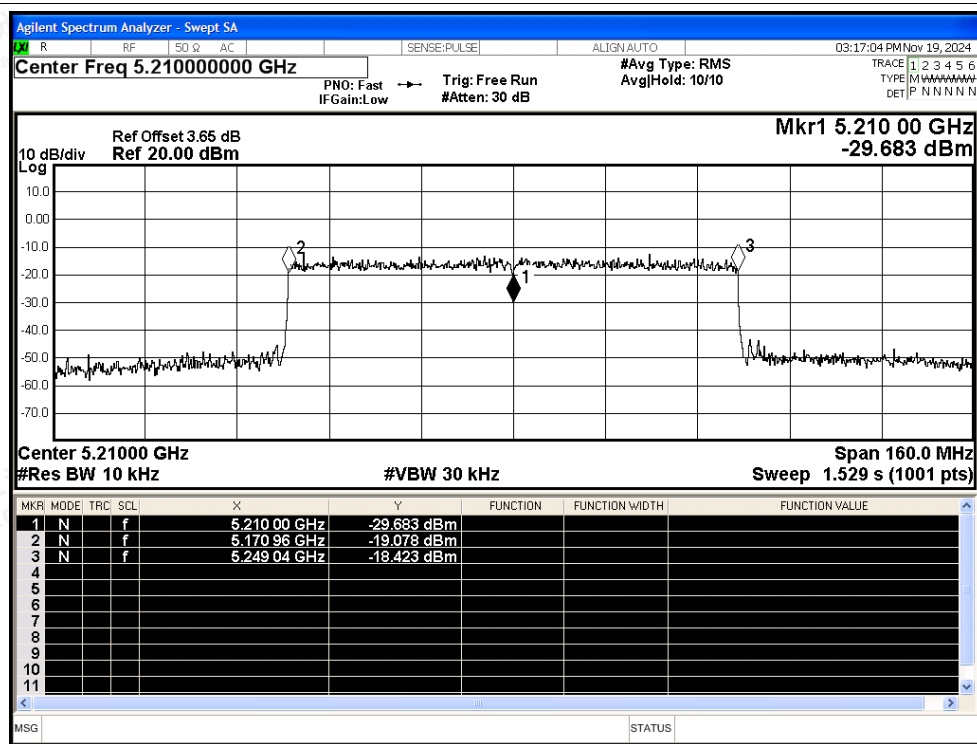

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant6

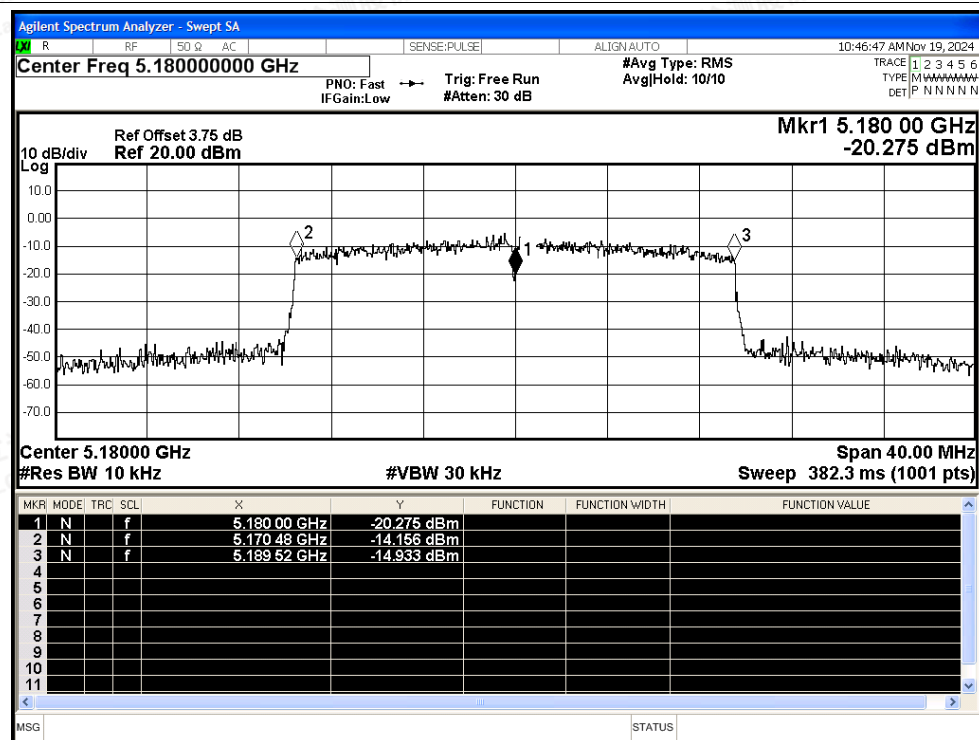

Freq. Stability NVNT ax20 5200MHz Ant6

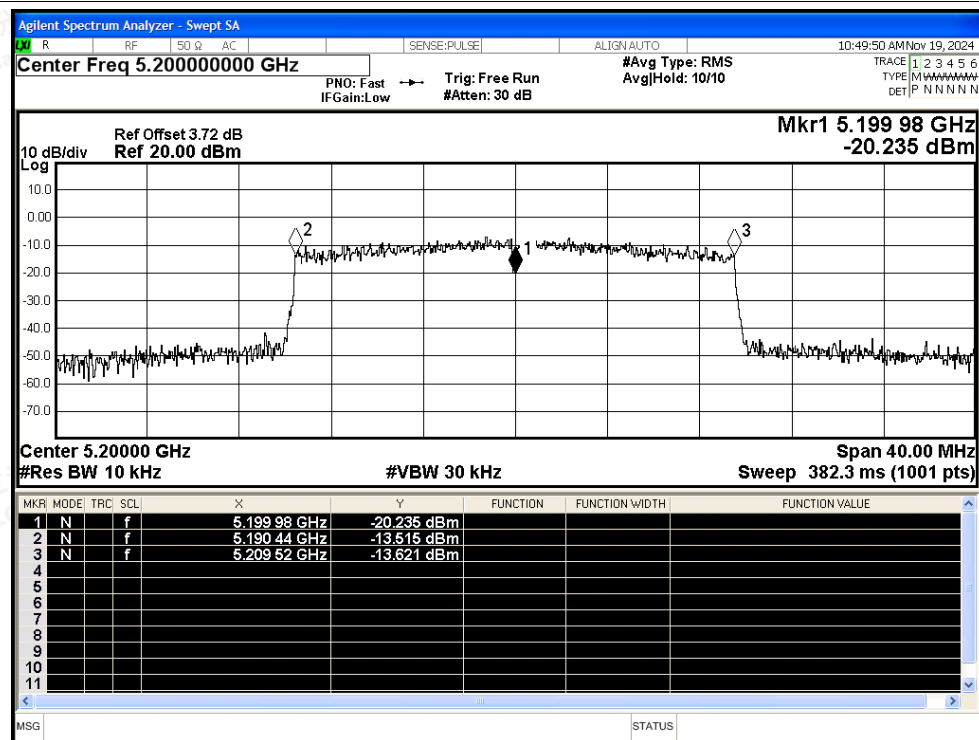

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant6

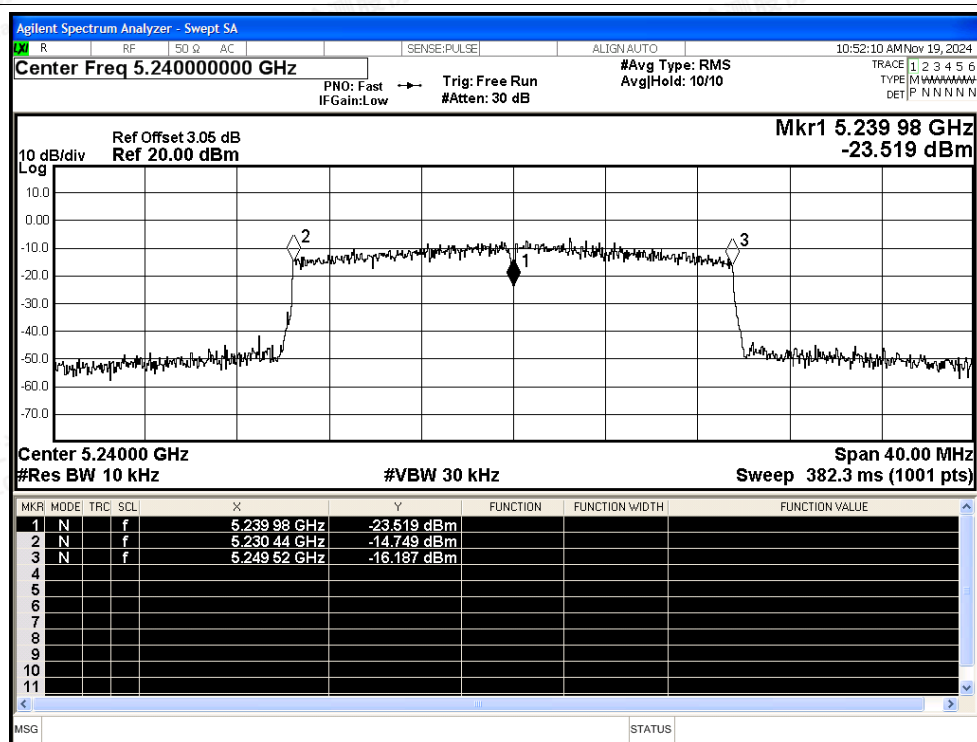

Freq. Stability NVNT ax40 5190MHz Ant6

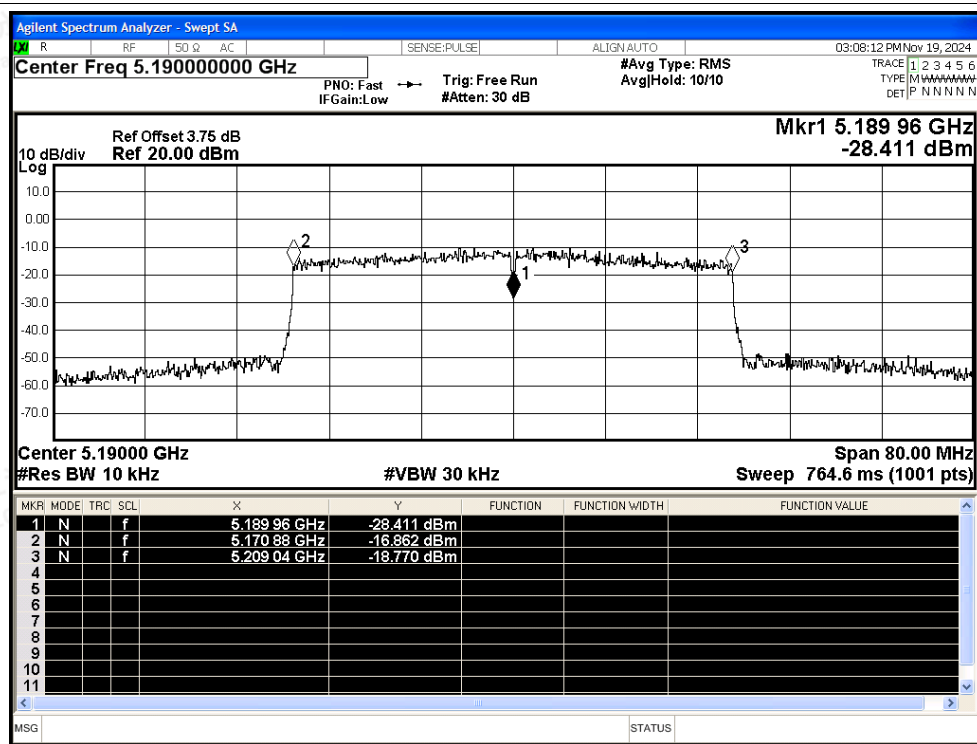

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant6

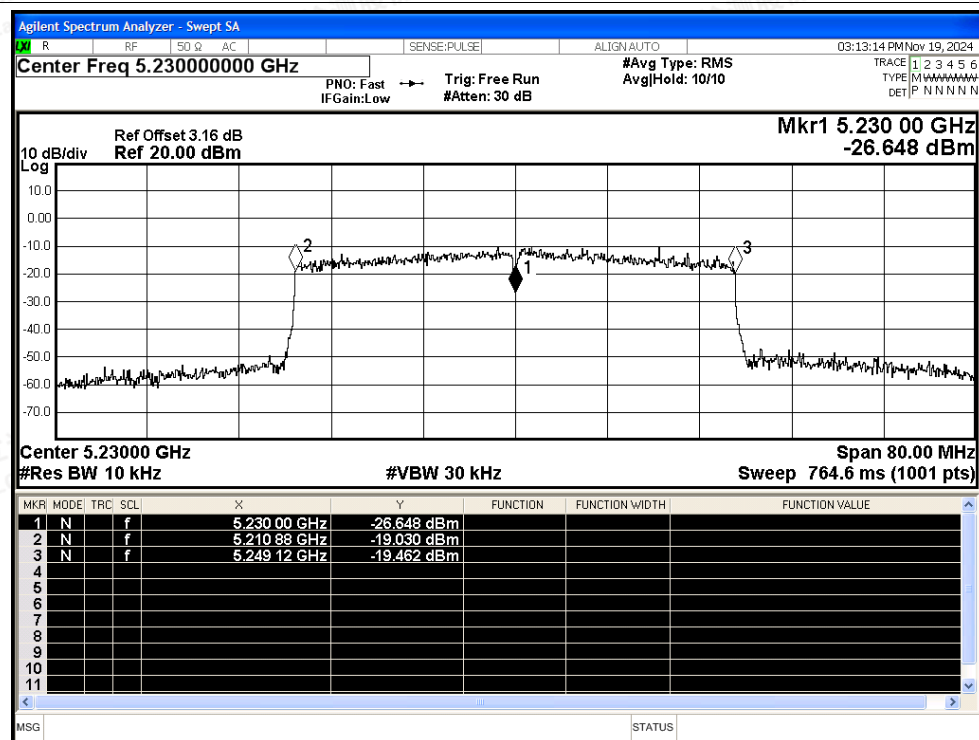

Freq. Stability NVNT ax80 5210MHz Ant6

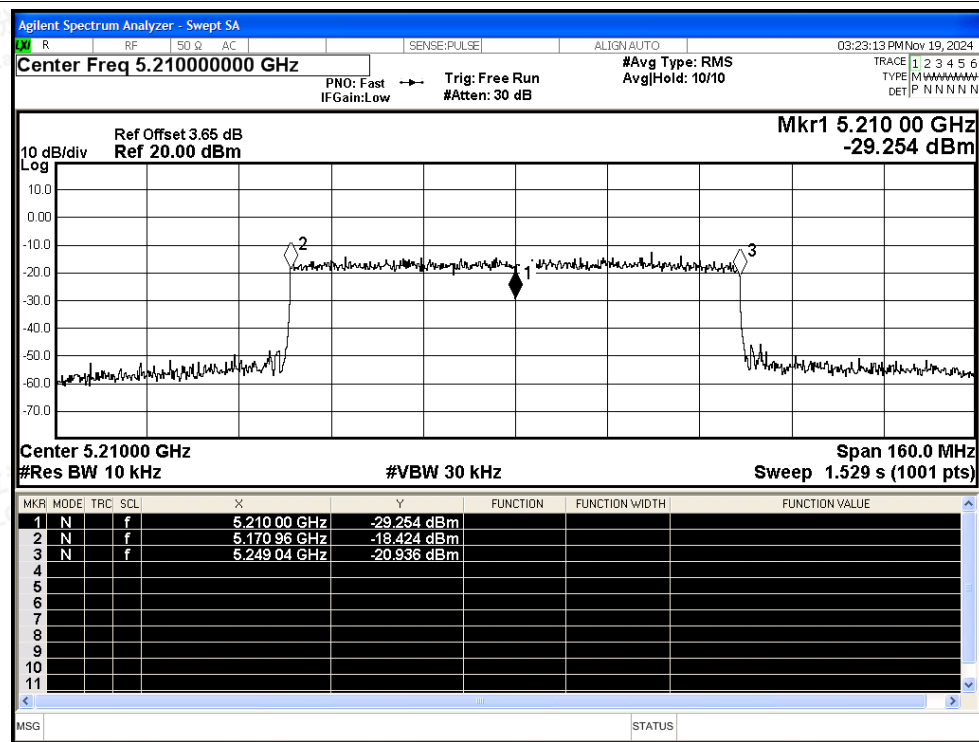

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant7	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant7	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant7	5240	0	0	25	Pass
NVNT	n20	5180	Ant7	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant7	5200	0	0	25	Pass
NVNT	n20	5240	Ant7	5240.02	20000	3.82	25	Pass
NVNT	n40	5190	Ant7	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant7	5229.96	-40000	-7.65	25	Pass
NVNT	ac20	5180	Ant7	5180.02	20000	3.86	25	Pass
NVNT	ac20	5200	Ant7	5200	0	0	25	Pass
NVNT	ac20	5240	Ant7	5240.06	60000	11.45	25	Pass
NVNT	ac40	5190	Ant7	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant7	5230	0	0	25	Pass
NVNT	ac80	5210	Ant7	5210	0	0	25	Pass
NVNT	ax20	5180	Ant7	5180	0	0	25	Pass
NVNT	ax20	5200	Ant7	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant7	5240.02	20000	3.82	25	Pass
NVNT	ax40	5190	Ant7	5189.96	-40000	-7.71	25	Pass
NVNT	ax40	5230	Ant7	5229.96	-40000	-7.65	25	Pass
NVNT	ax80	5210	Ant7	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant7

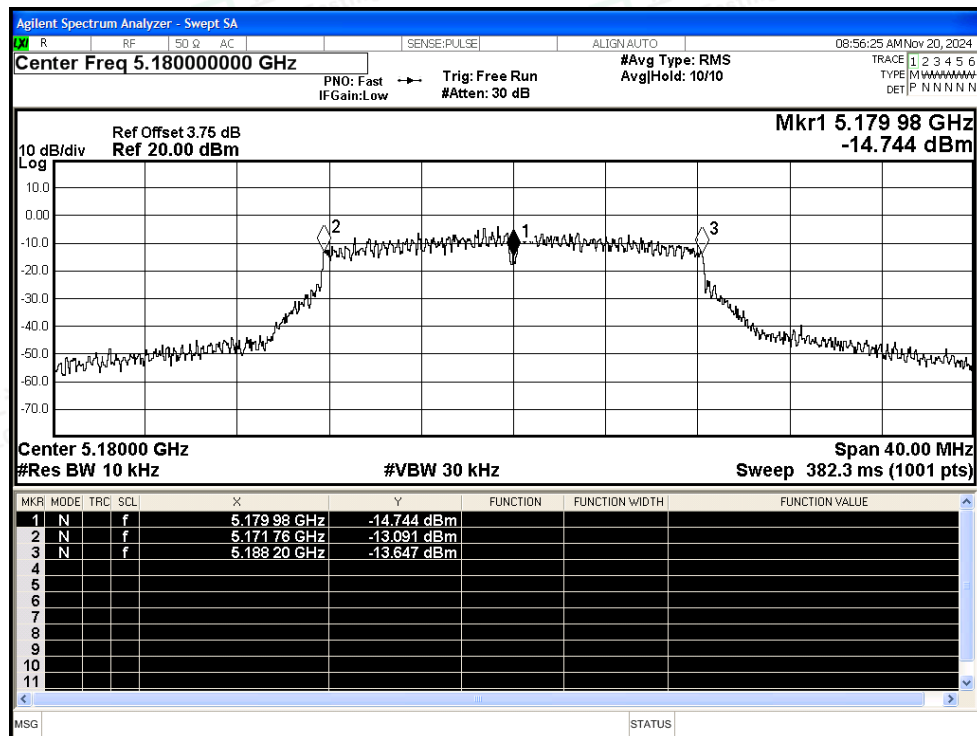

Freq. Stability NVNT a 5200MHz Ant7

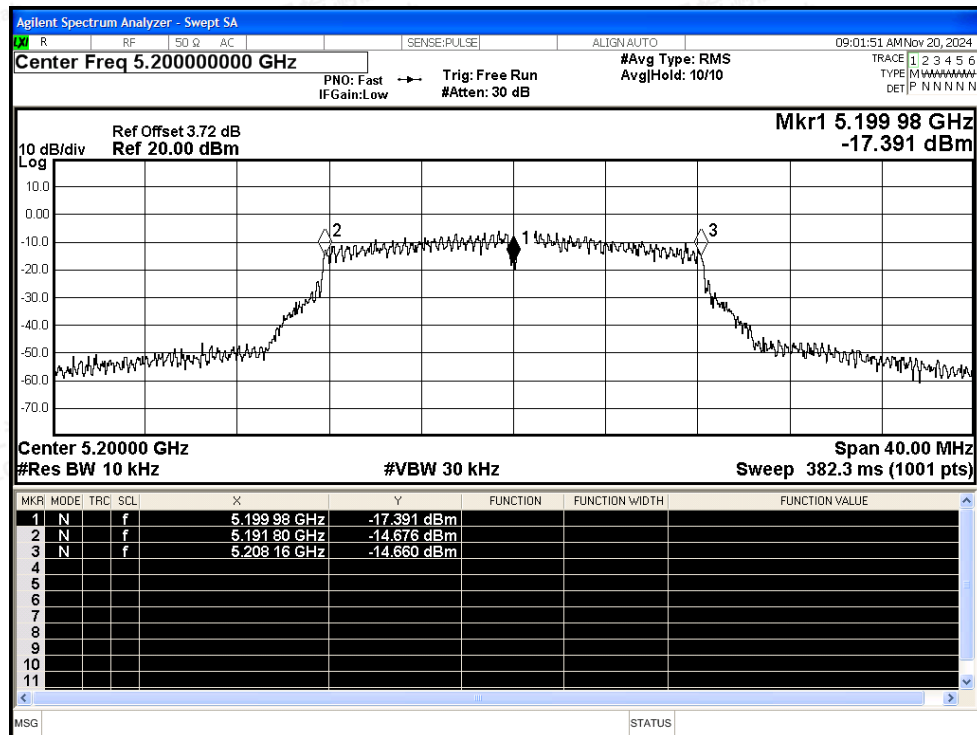

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant7

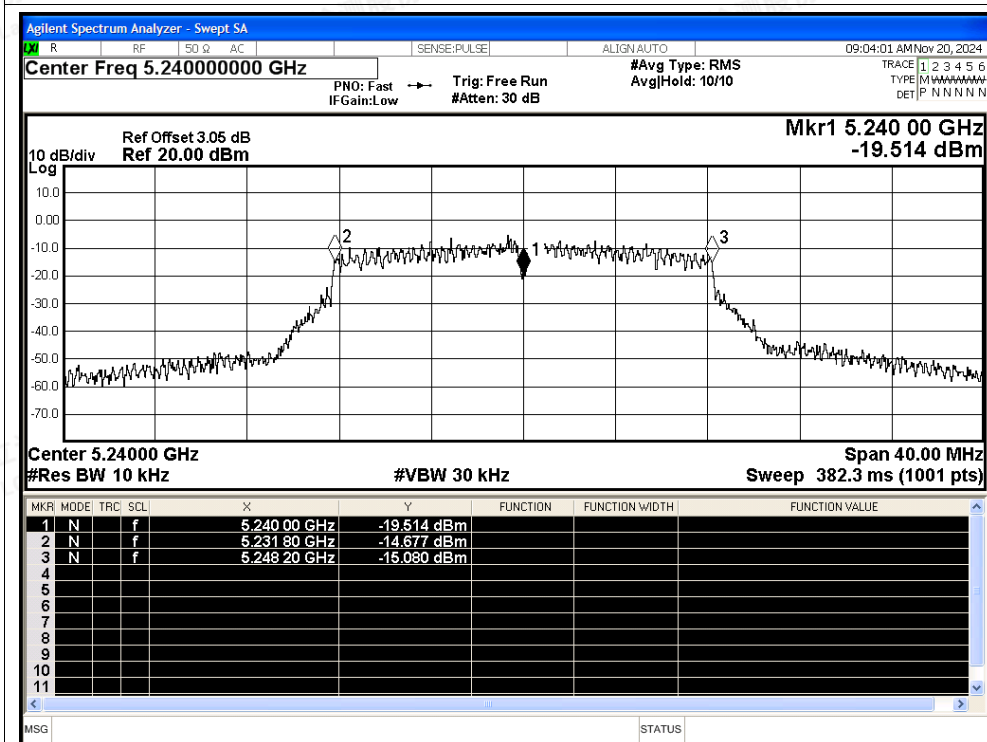

Freq. Stability NVNT n20 5180MHz Ant7

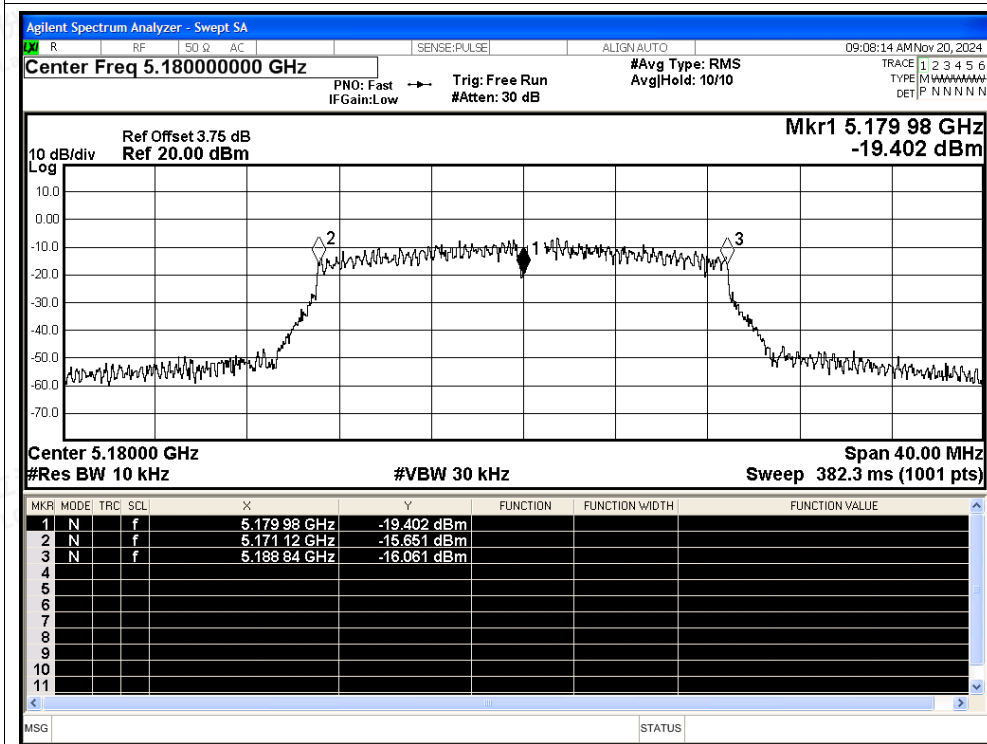

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant7

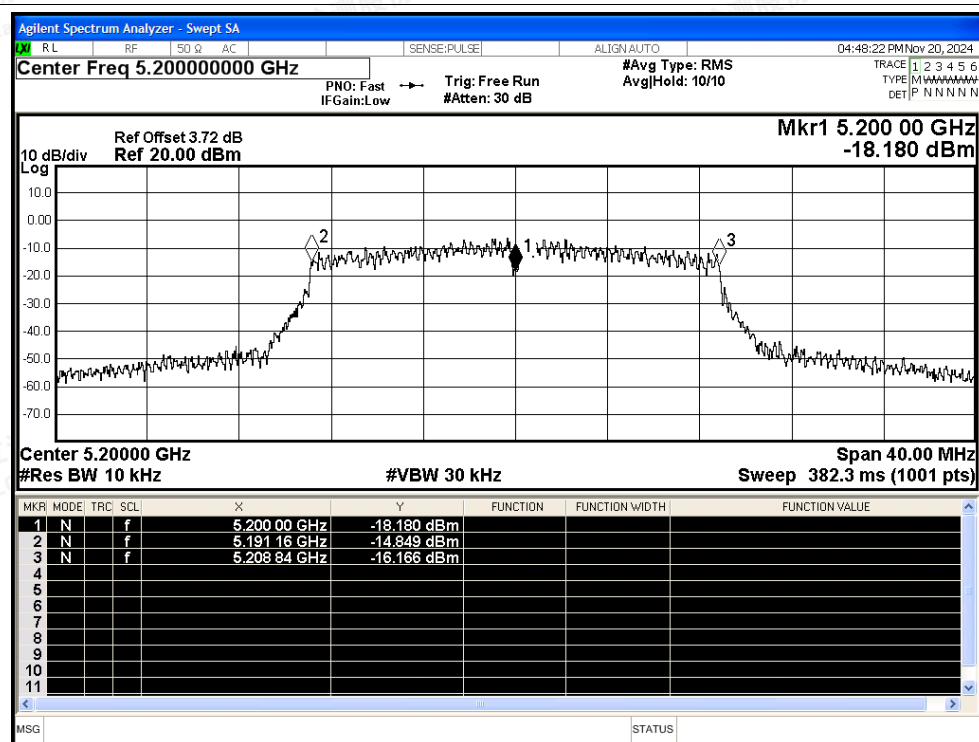

Freq. Stability NVNT n20 5240MHz Ant7

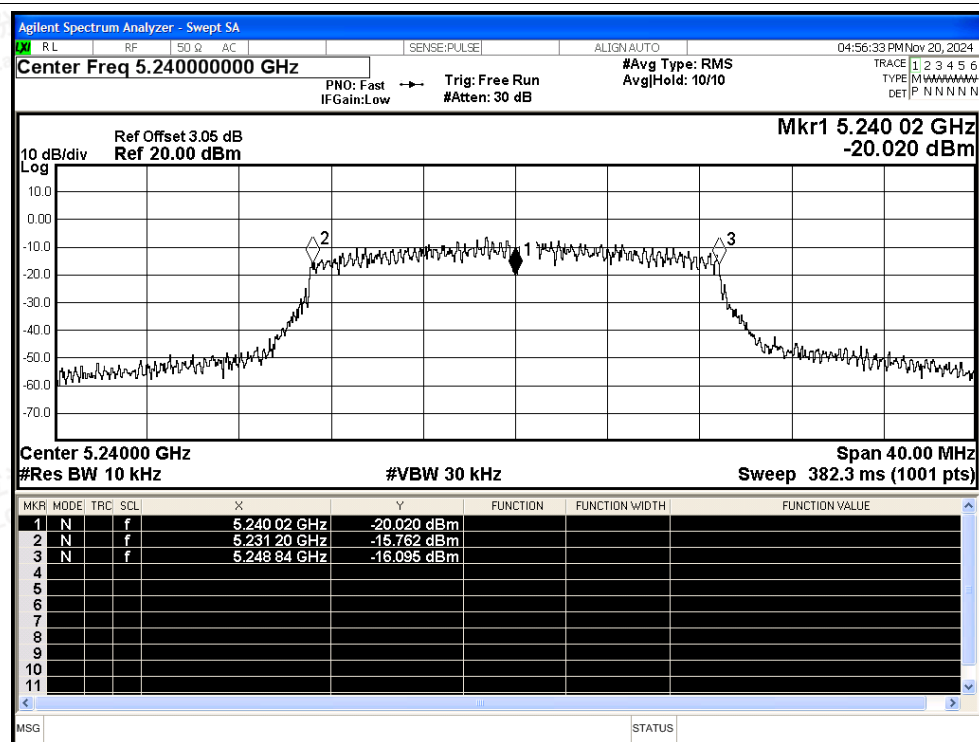

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant7

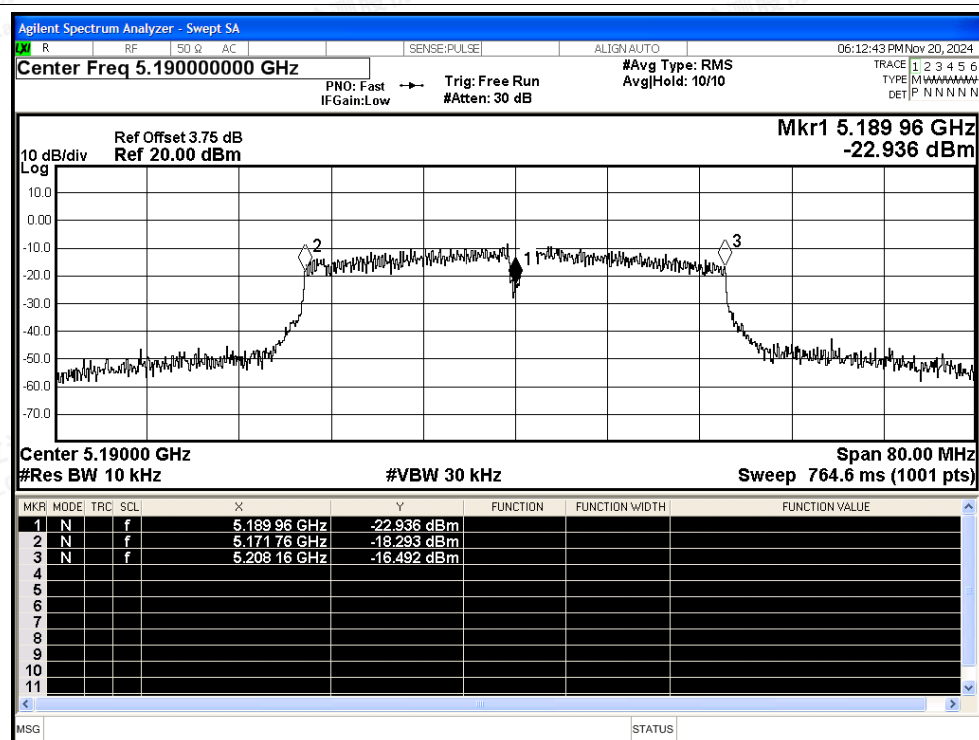

Freq. Stability NVNT n40 5230MHz Ant7

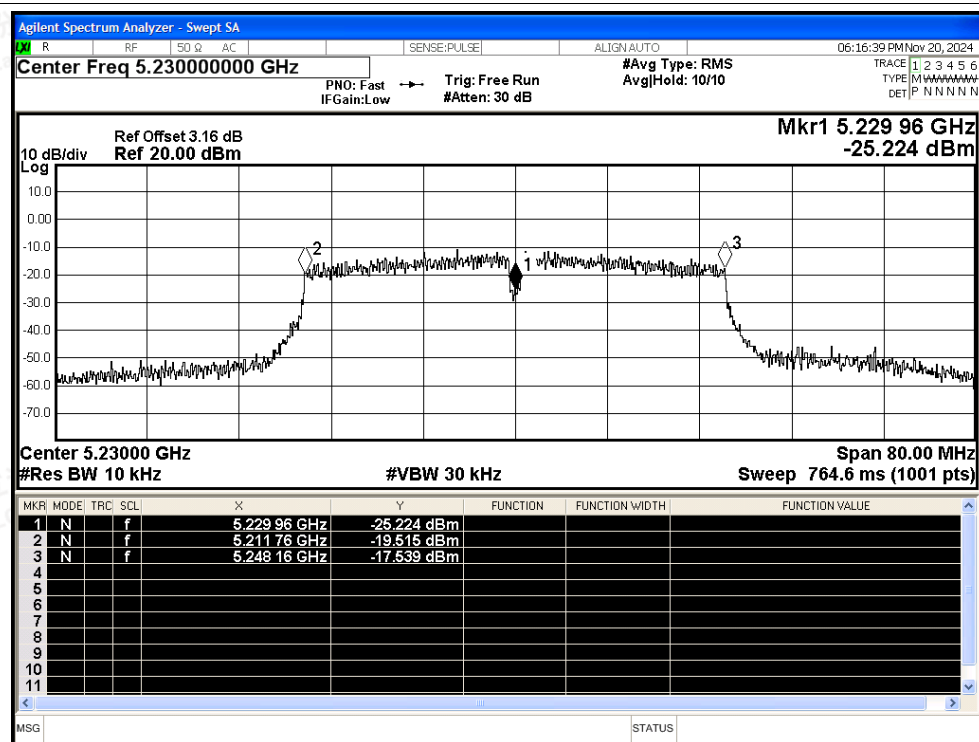

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant7

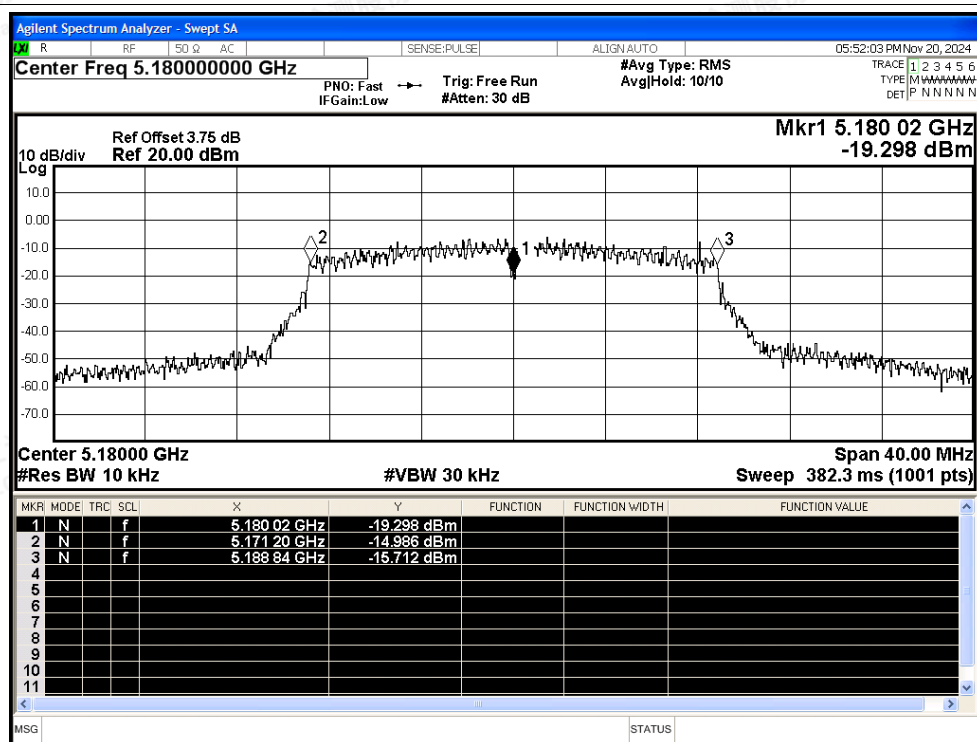

Freq. Stability NVNT ac20 5200MHz Ant7

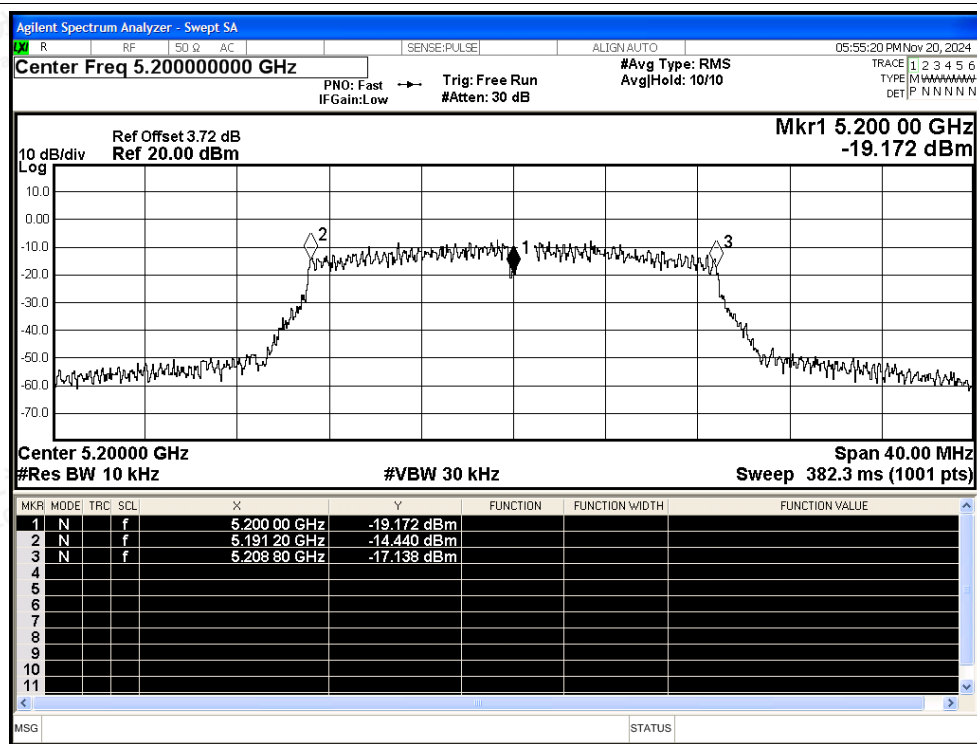

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant7

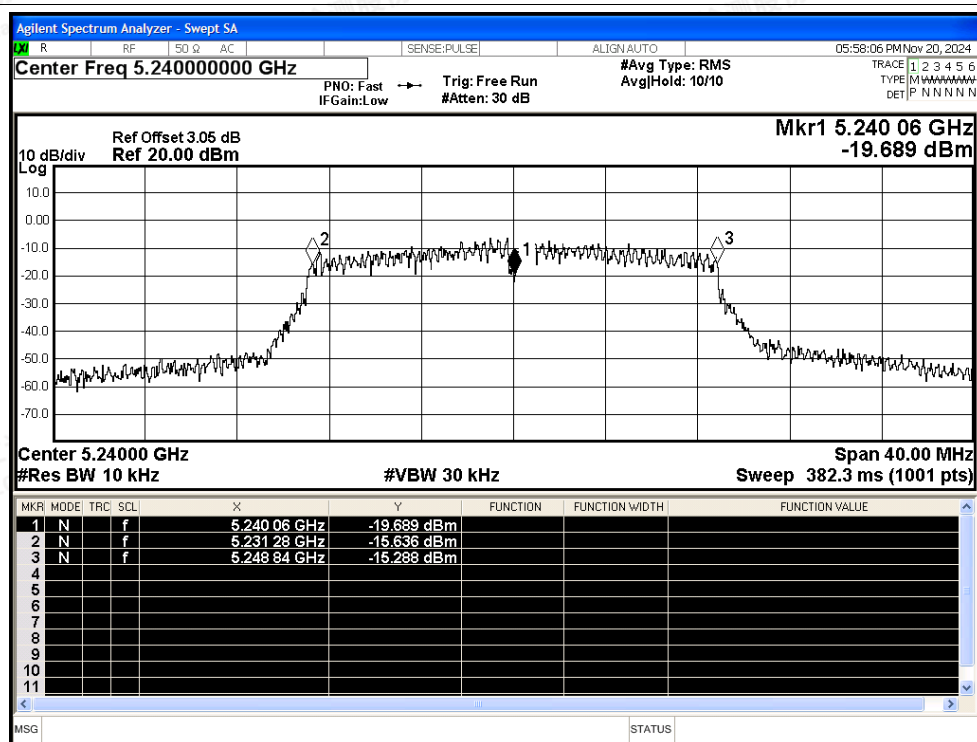

Freq. Stability NVNT ac40 5190MHz Ant7

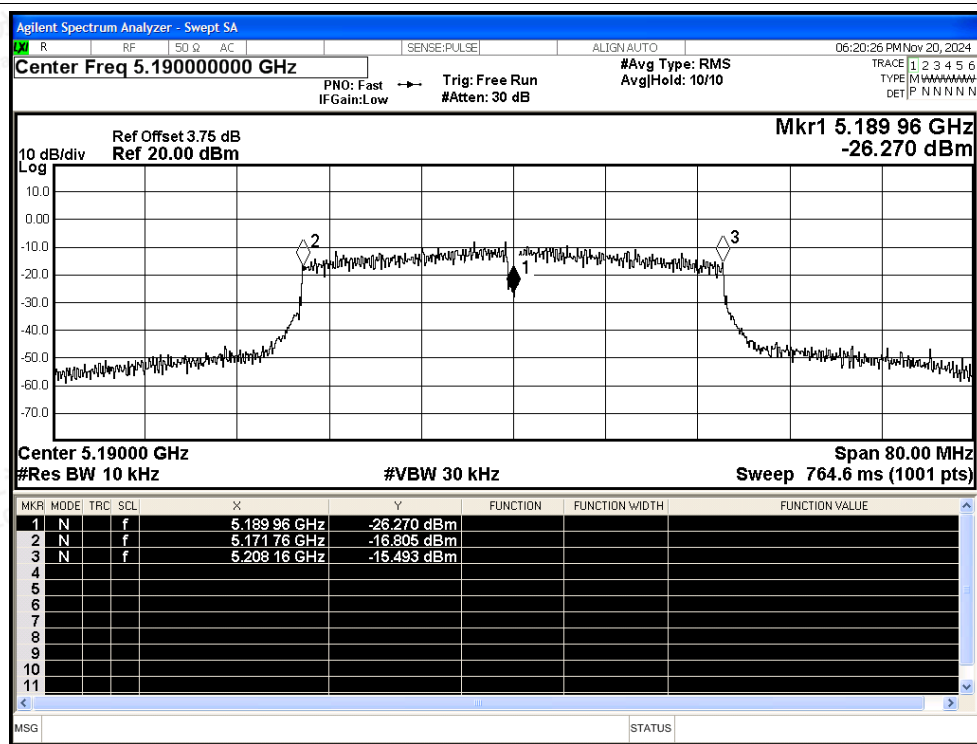

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant7

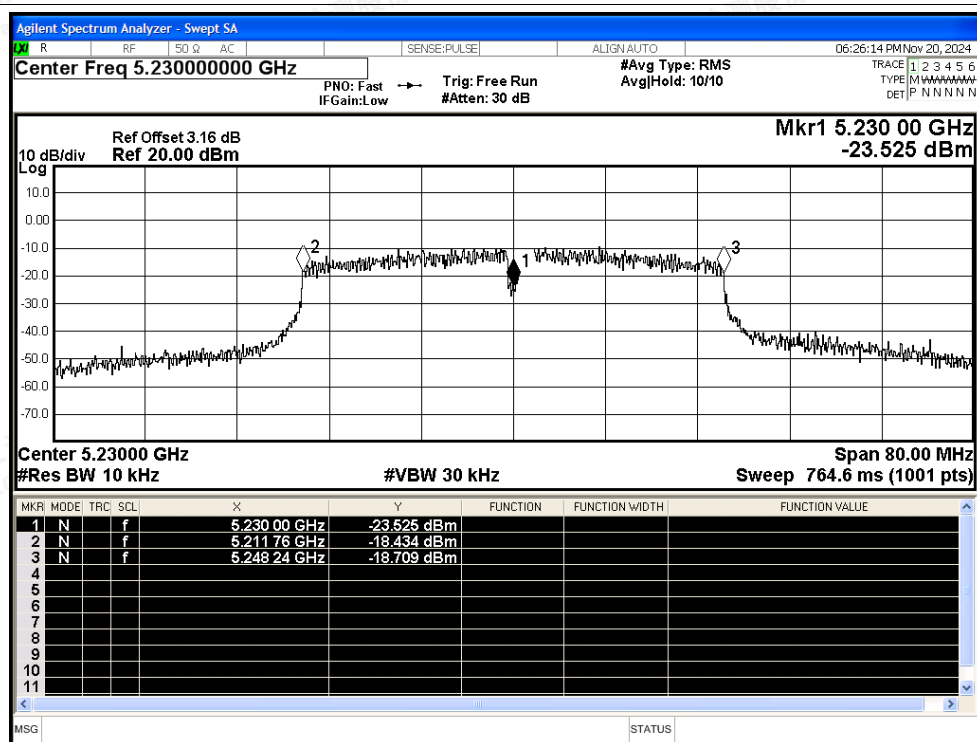

Freq. Stability NVNT ac80 5210MHz Ant7


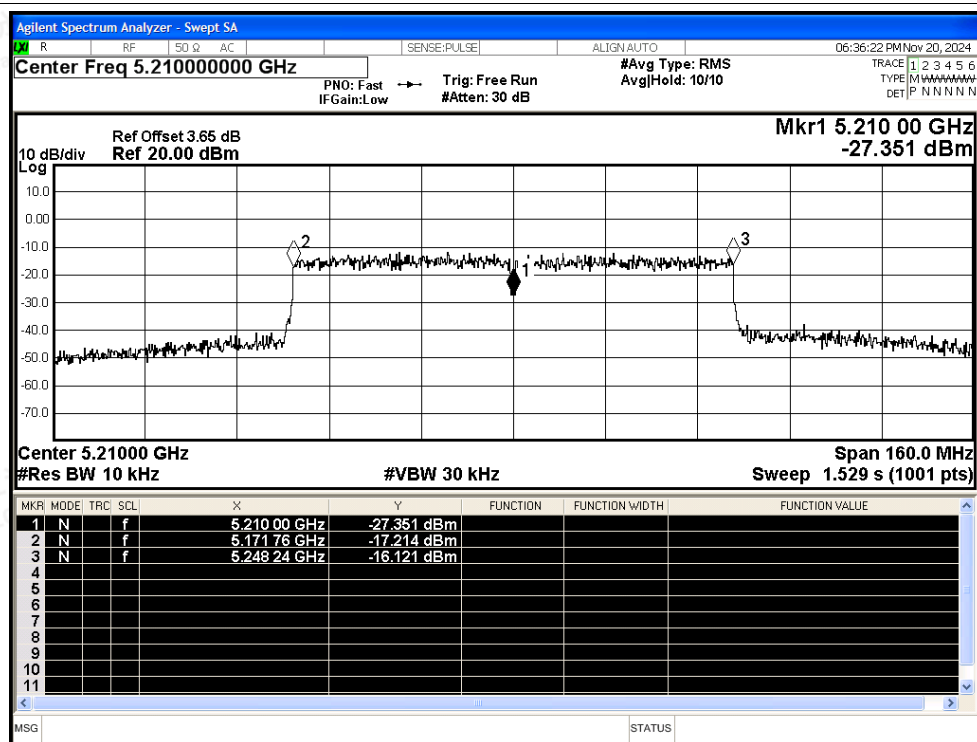


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

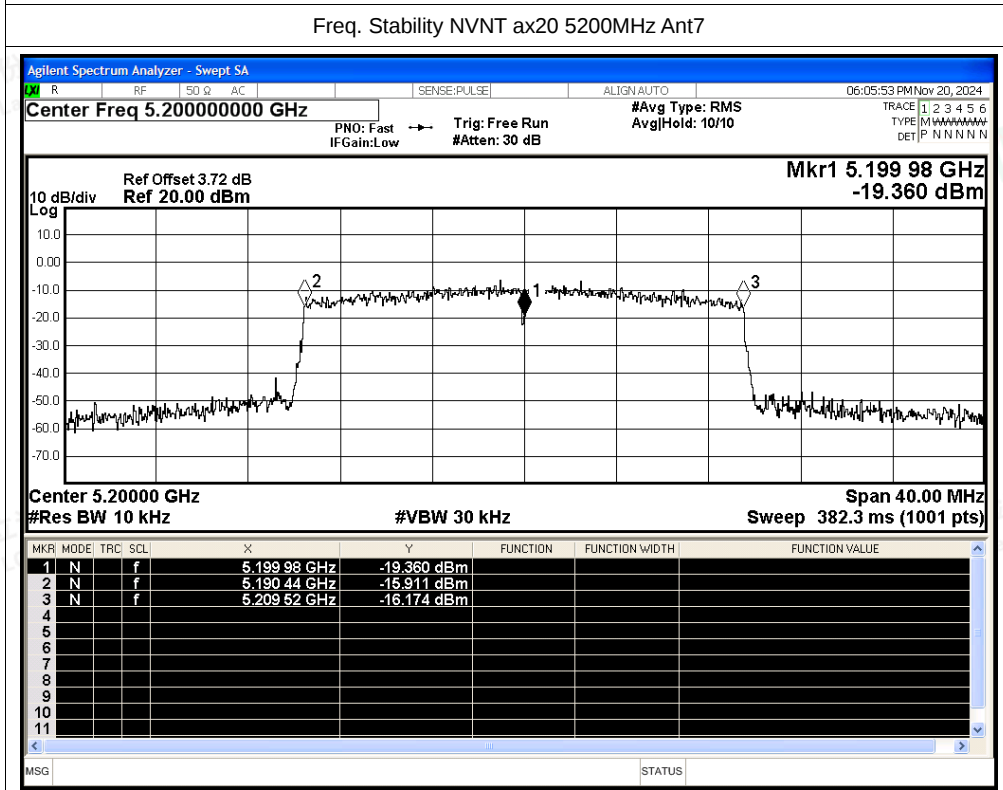
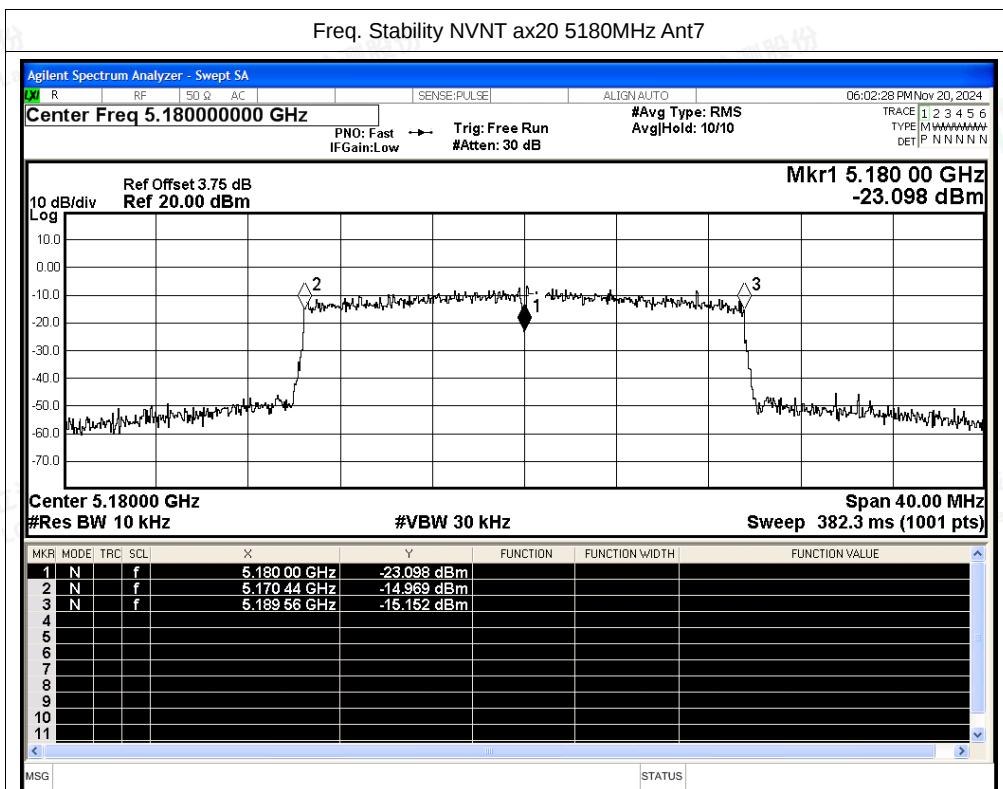


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

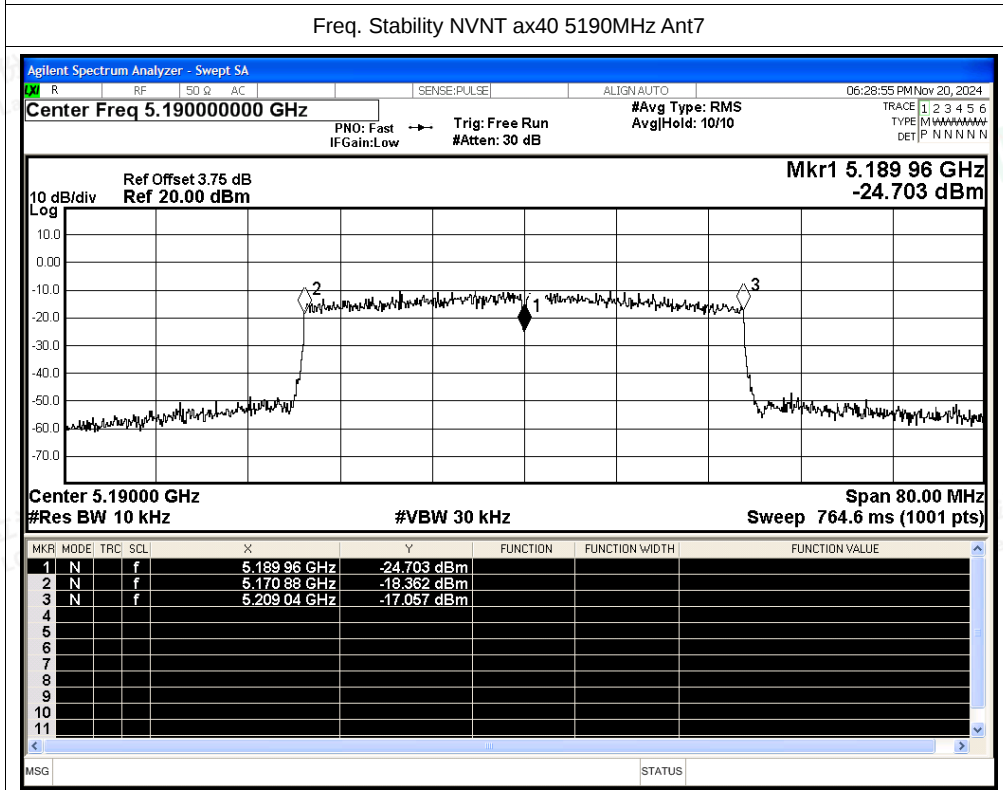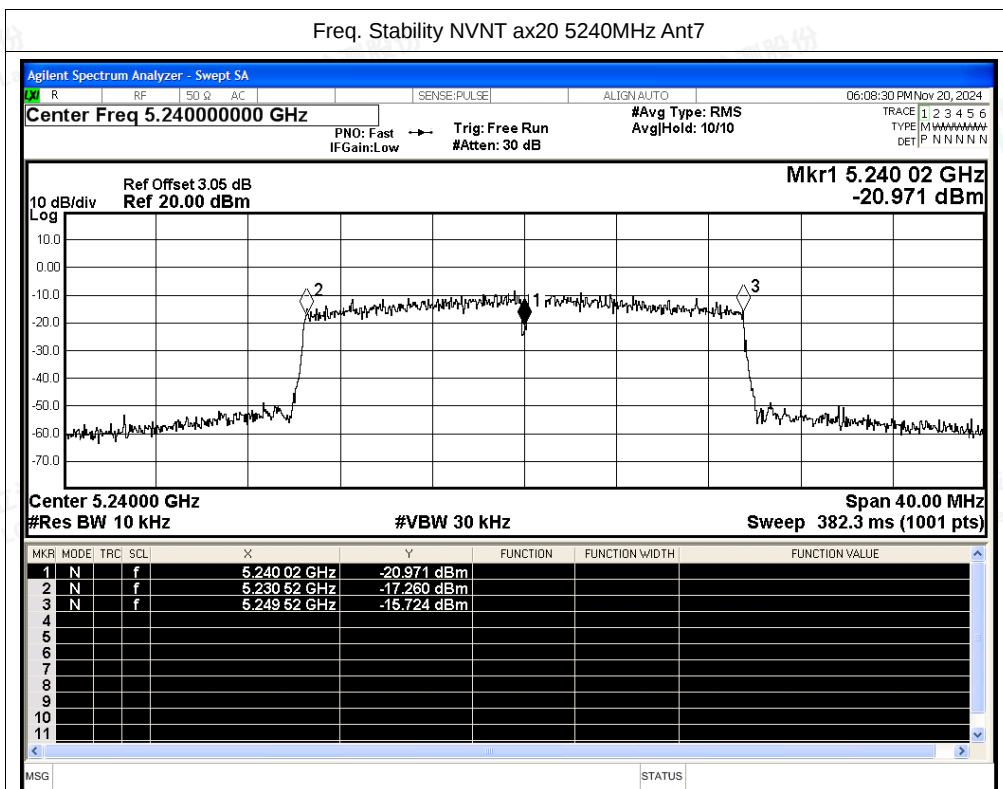

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant7

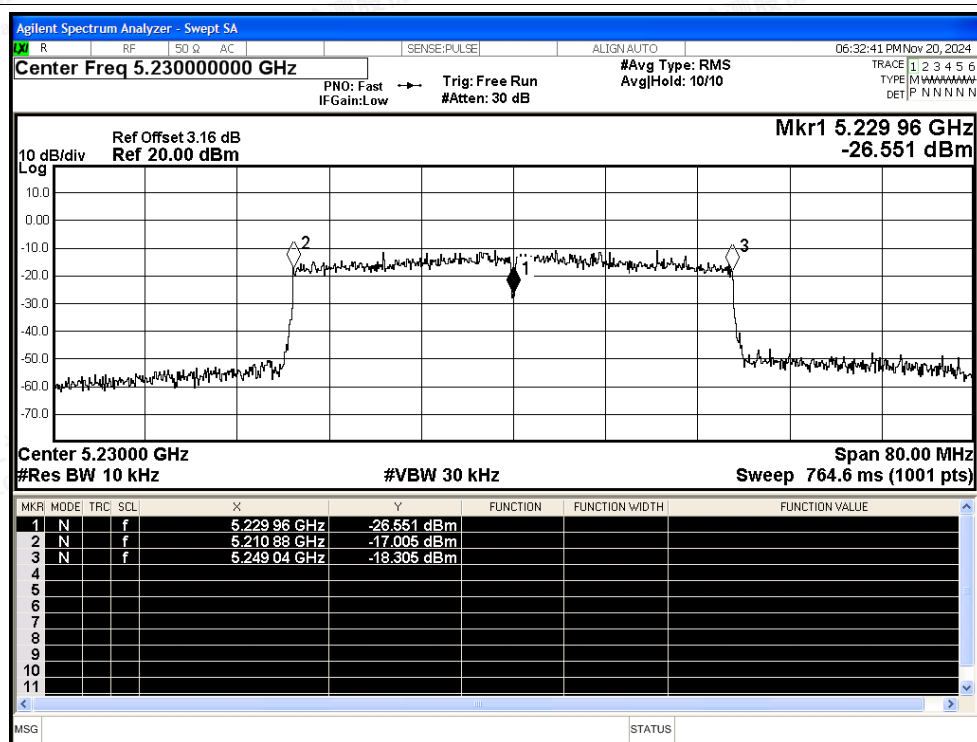

Freq. Stability NVNT ax80 5210MHz Ant7

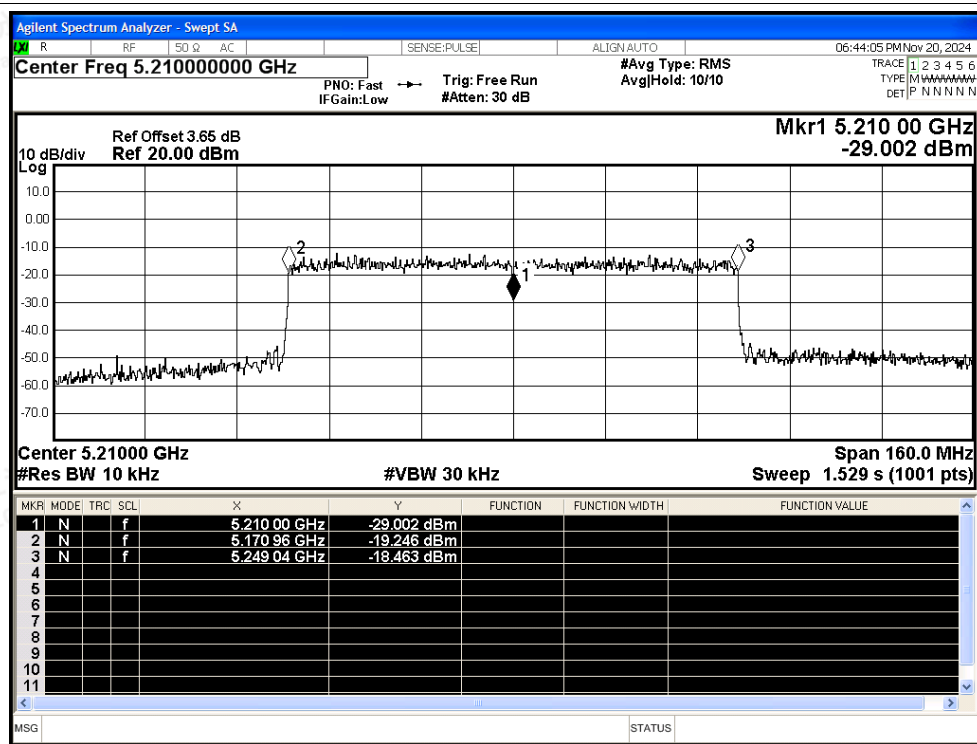

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant6	54.74	2.62	0.72
NVNT	a	5200	Ant6	58.68	2.32	0.72
NVNT	a	5240	Ant6	58.5	2.33	0.72
NVNT	n20	5180	Ant6	57.06	2.44	0.77
NVNT	n20	5200	Ant6	55.1	2.59	0.77
NVNT	n20	5240	Ant6	56.61	2.47	0.77
NVNT	n40	5190	Ant6	53.72	2.7	0.81
NVNT	n40	5230	Ant6	53.06	2.75	0.81
NVNT	ac20	5180	Ant6	55.47	2.56	0.76
NVNT	ac20	5200	Ant6	54.63	2.63	0.76
NVNT	ac20	5240	Ant6	55	2.6	0.76
NVNT	ac40	5190	Ant6	54.01	2.68	0.8
NVNT	ac40	5230	Ant6	52.94	2.76	0.8
NVNT	ac80	5210	Ant6	25.31	5.97	1.98
NVNT	ax20	5180	Ant6	50.88	2.93	0.99
NVNT	ax20	5200	Ant6	50.88	2.93	0.99
NVNT	ax20	5240	Ant6	48.89	3.11	0.99
NVNT	ax40	5190	Ant6	45.96	3.38	1
NVNT	ax40	5230	Ant6	47.53	3.23	1
NVNT	ax80	5210	Ant6	31.45	5.02	1.97






Test Graphs

Duty Cycle NVNT a 5180MHz Ant6

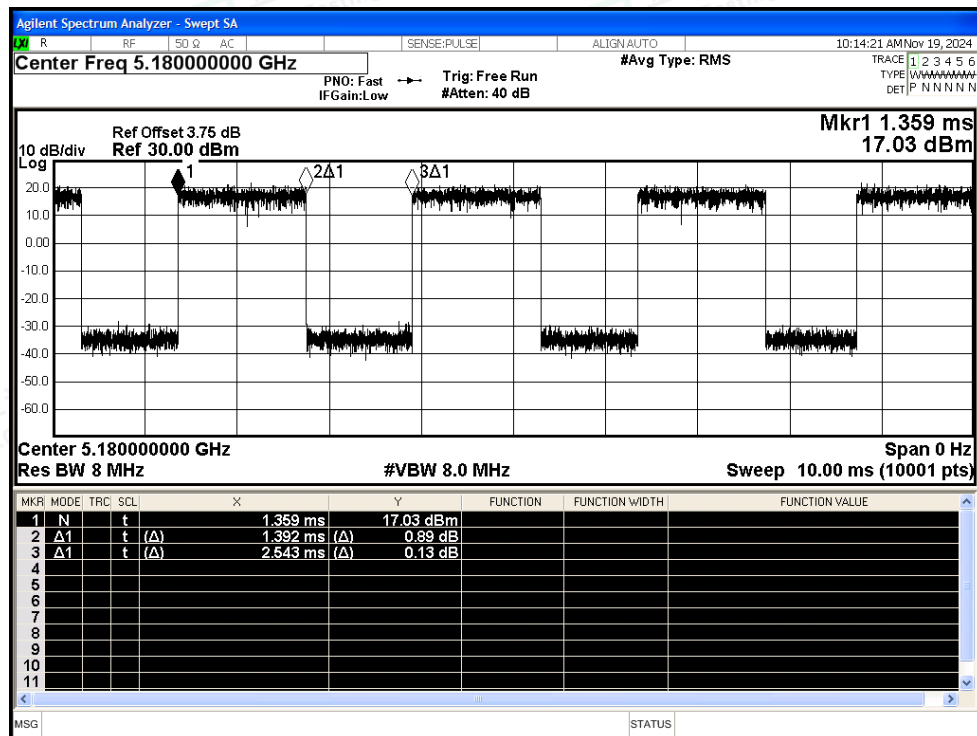

Duty Cycle NVNT a 5200MHz Ant6

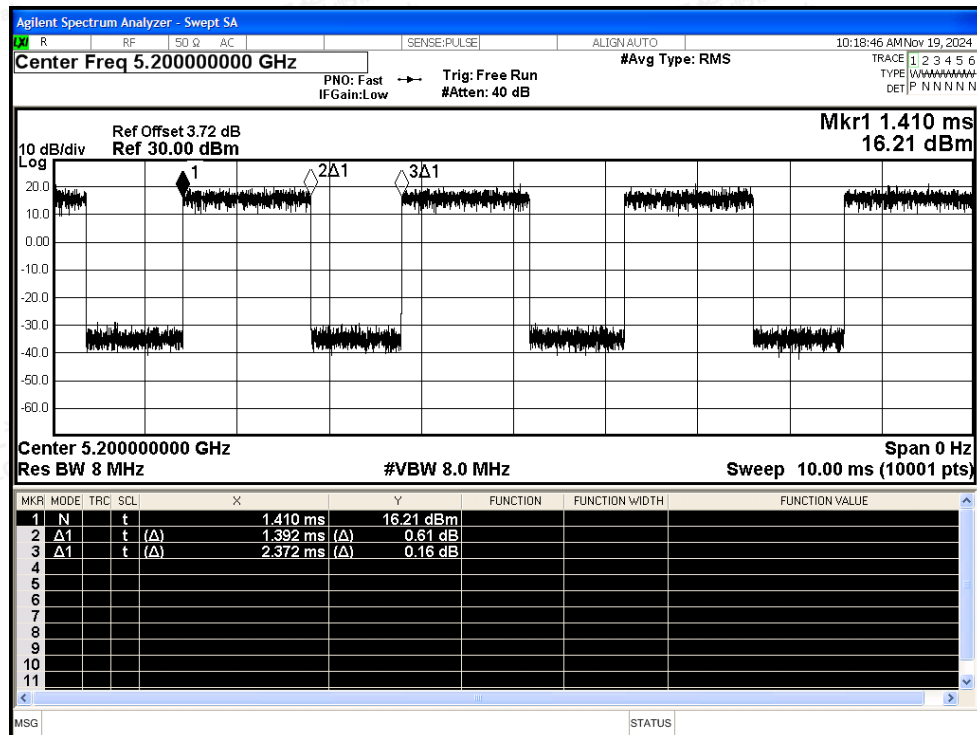

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant6

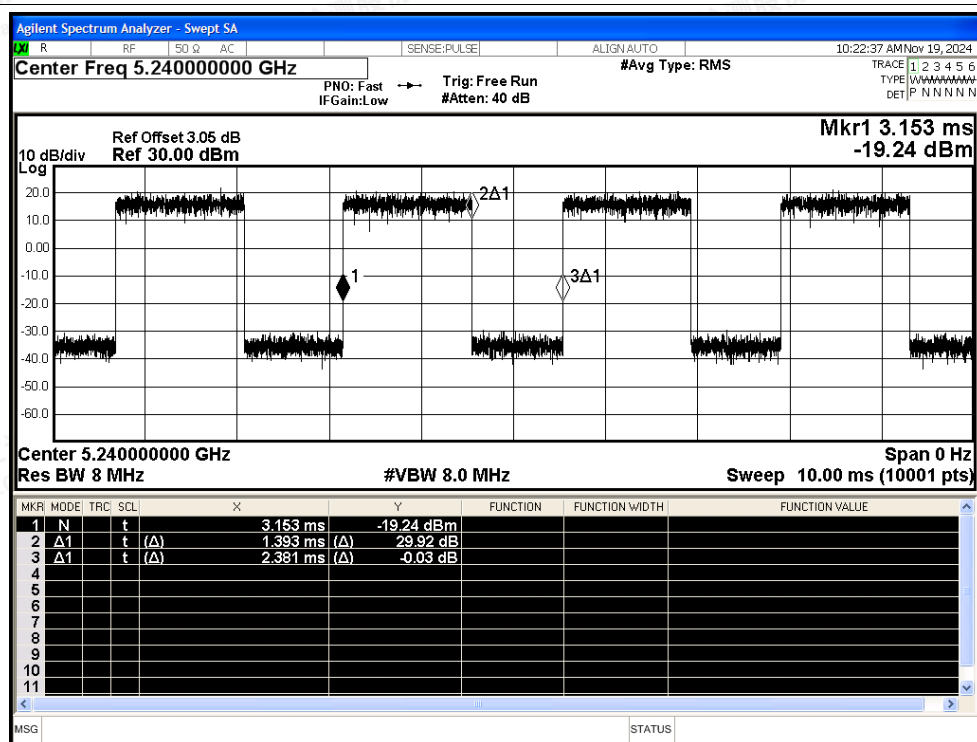

Duty Cycle NVNT n20 5180MHz Ant6

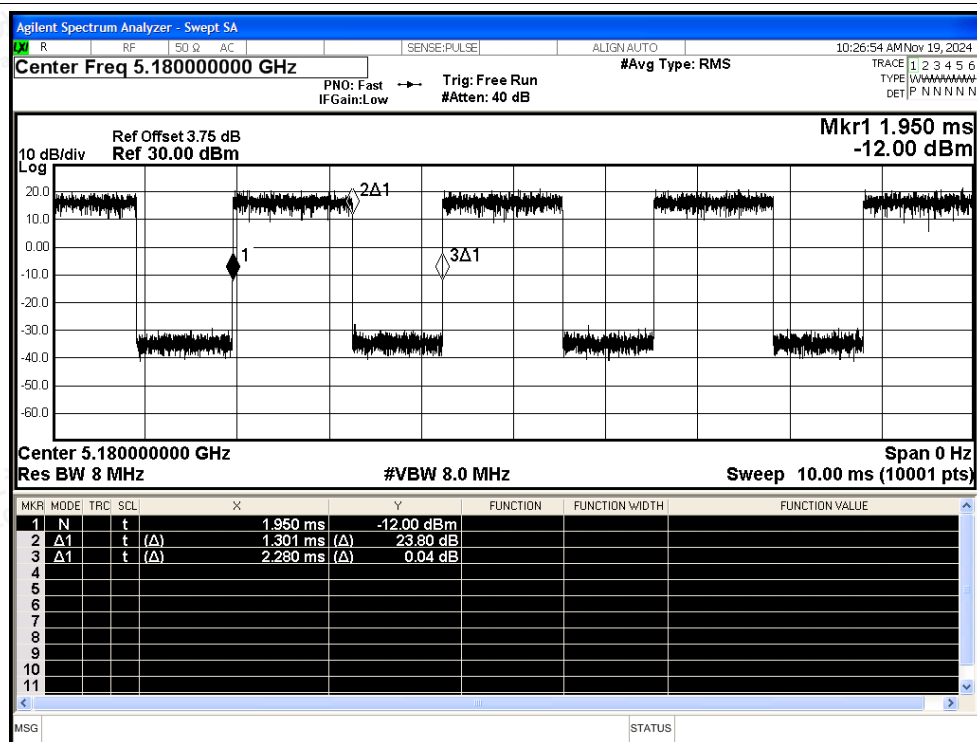

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant6

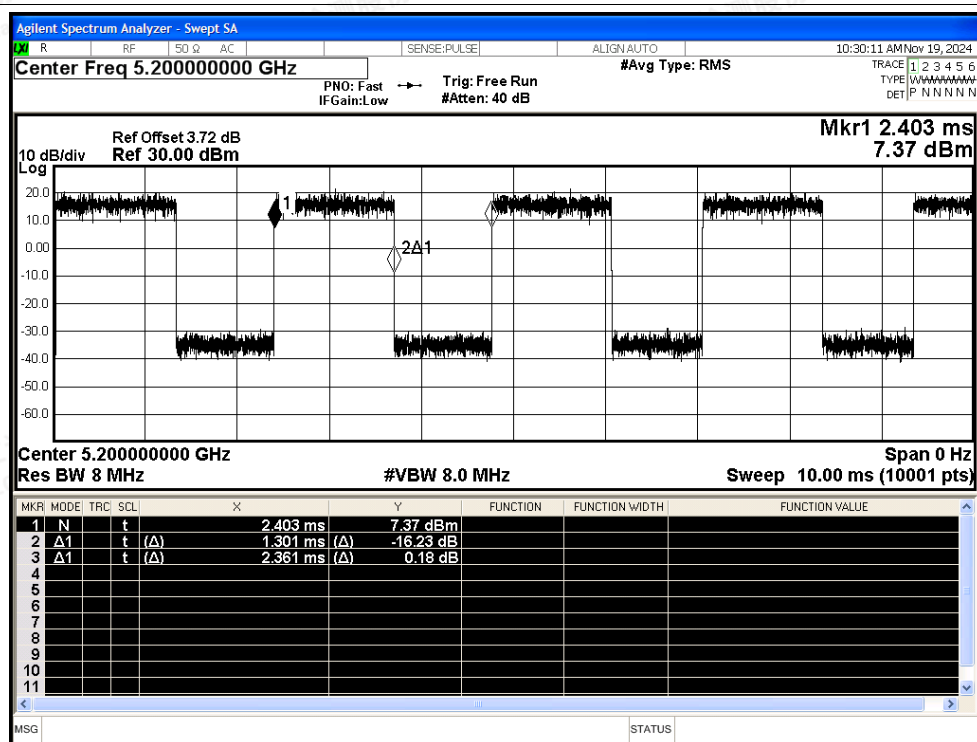

Duty Cycle NVNT n20 5240MHz Ant6

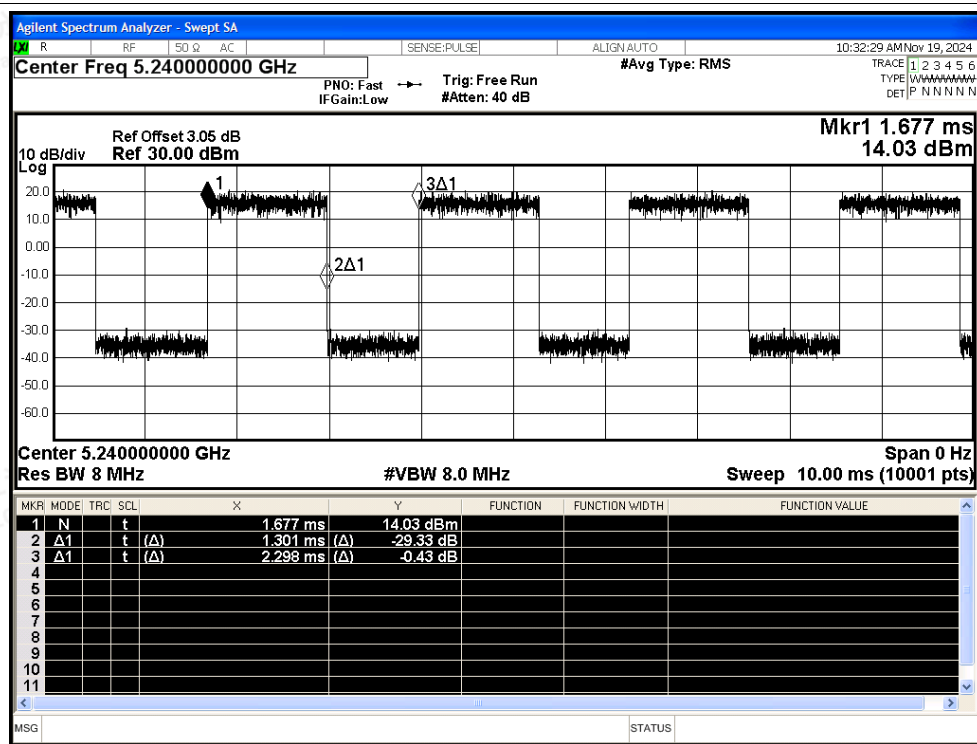

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant6

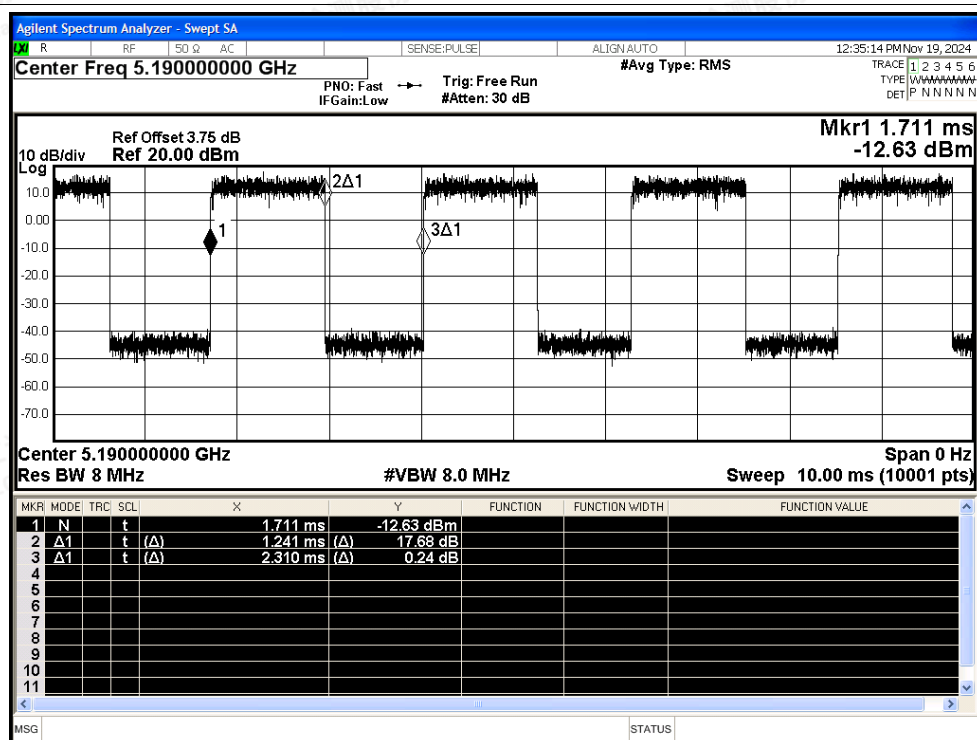

Duty Cycle NVNT n40 5230MHz Ant6

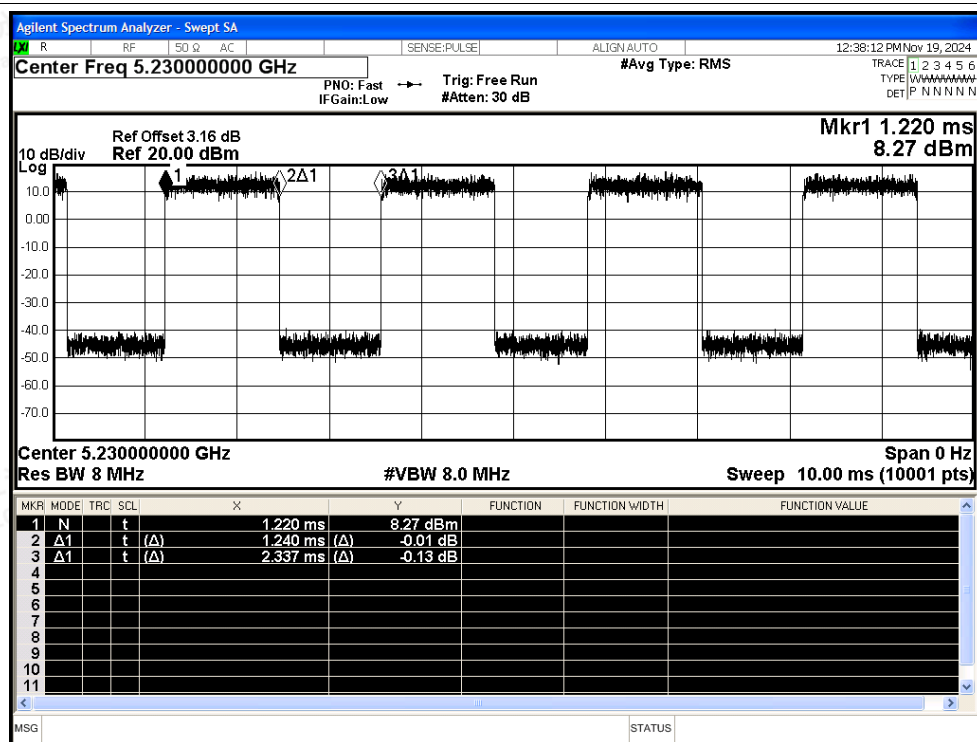

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant6

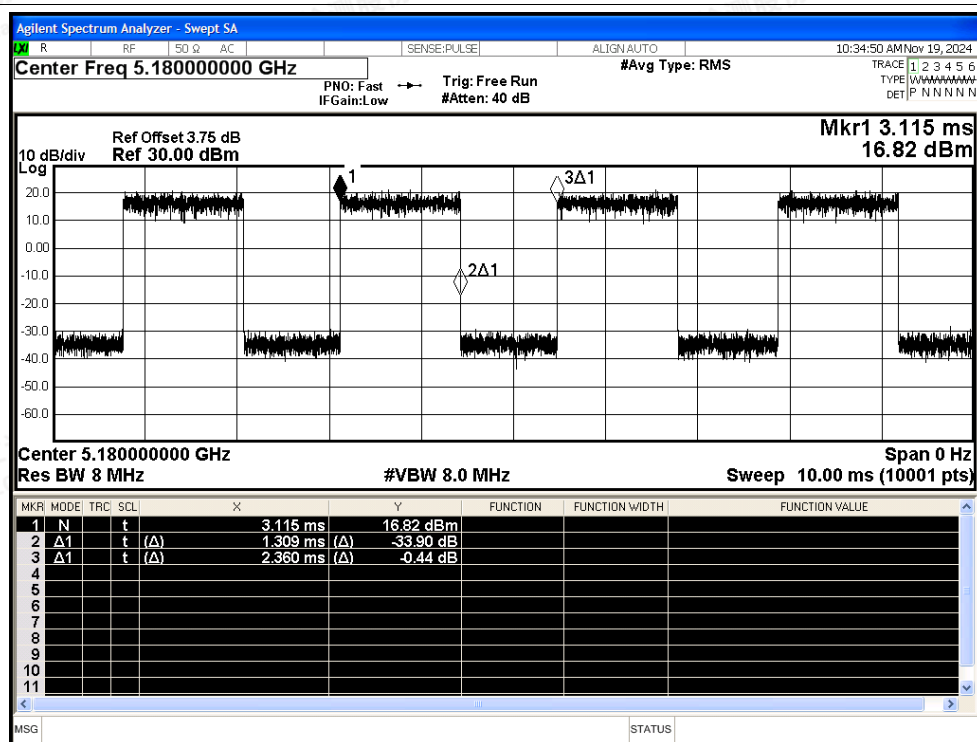

Duty Cycle NVNT ac20 5200MHz Ant6

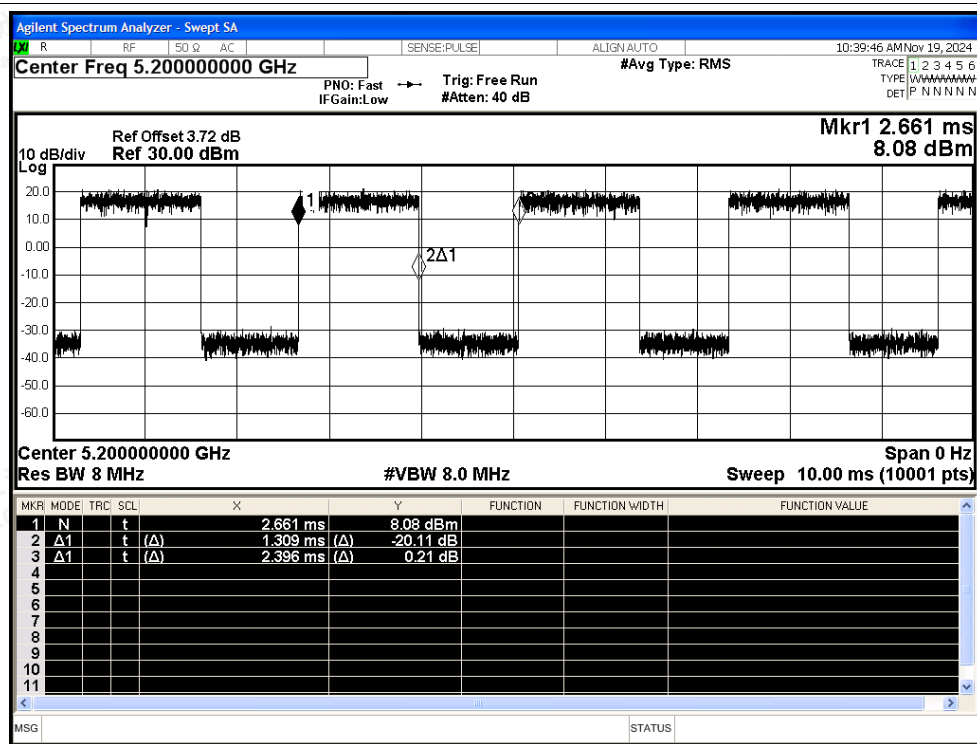

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant6

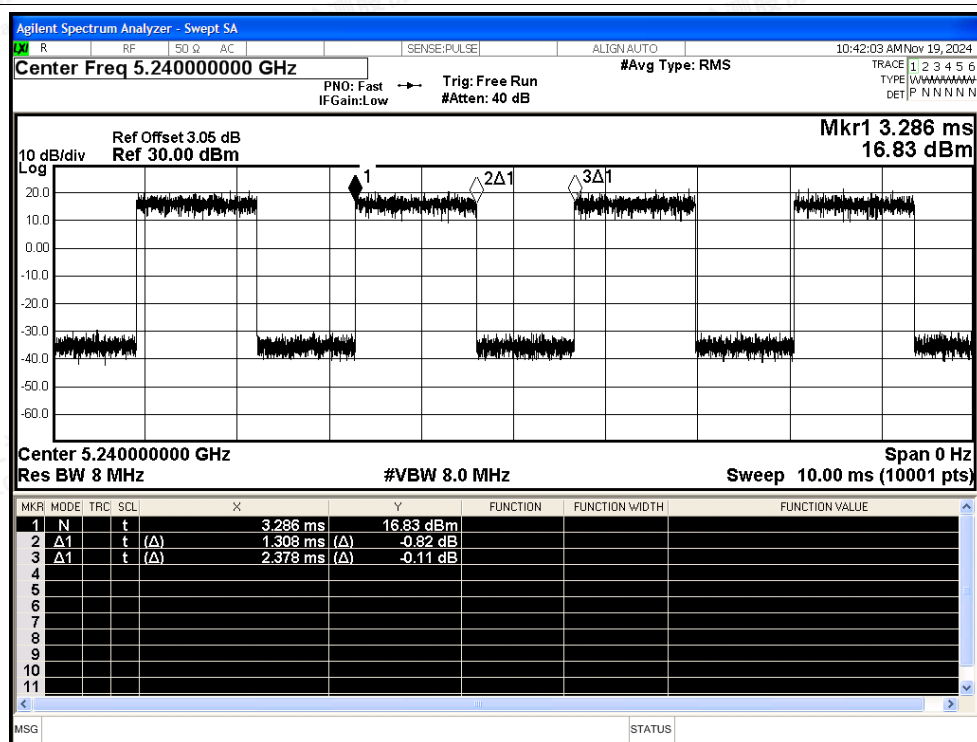

Duty Cycle NVNT ac40 5190MHz Ant6

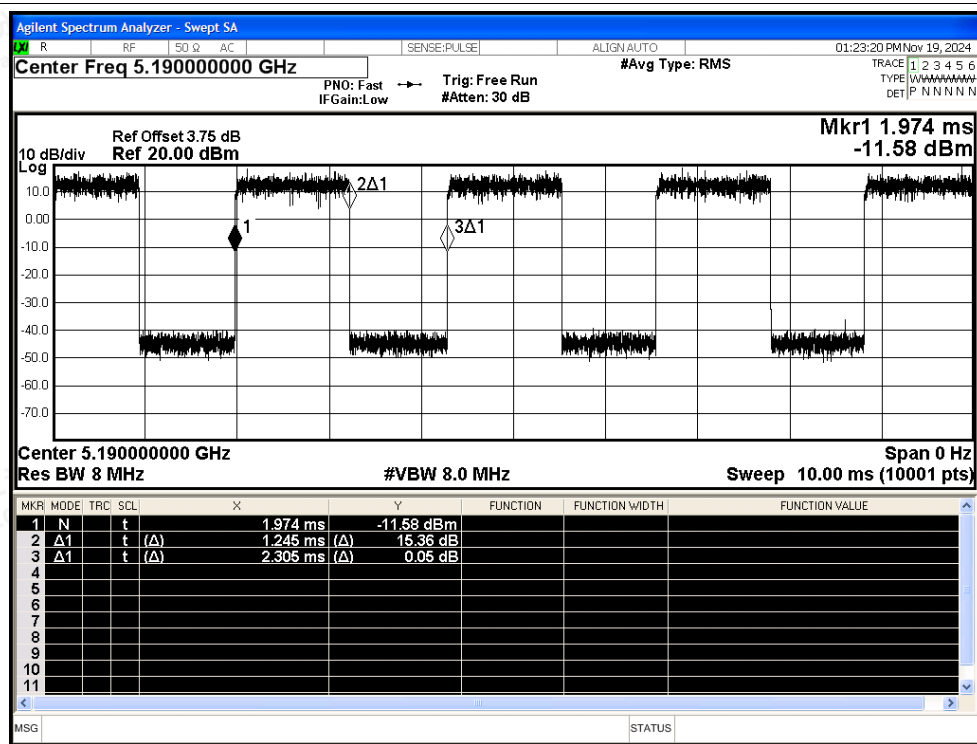

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant6

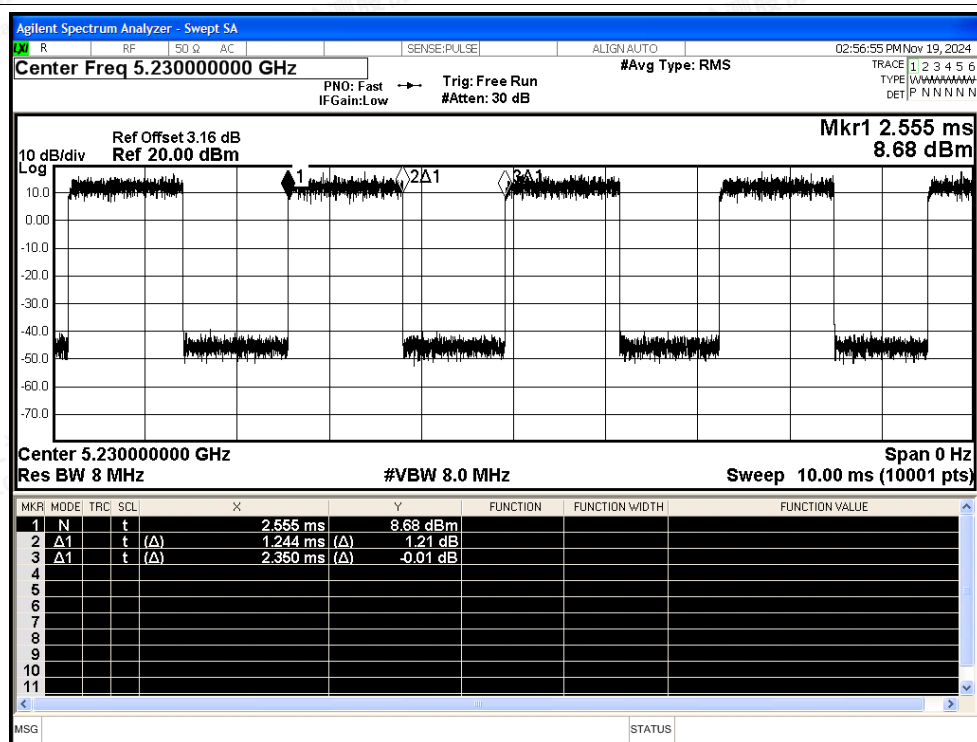

Duty Cycle NVNT ac80 5210MHz Ant6

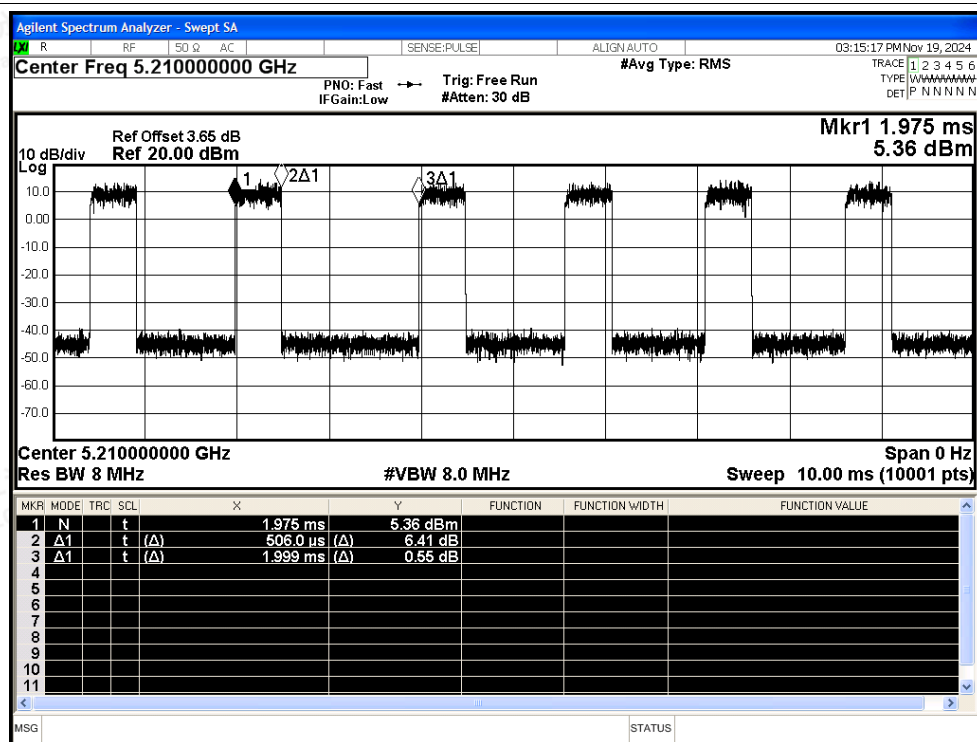

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5180MHz Ant6

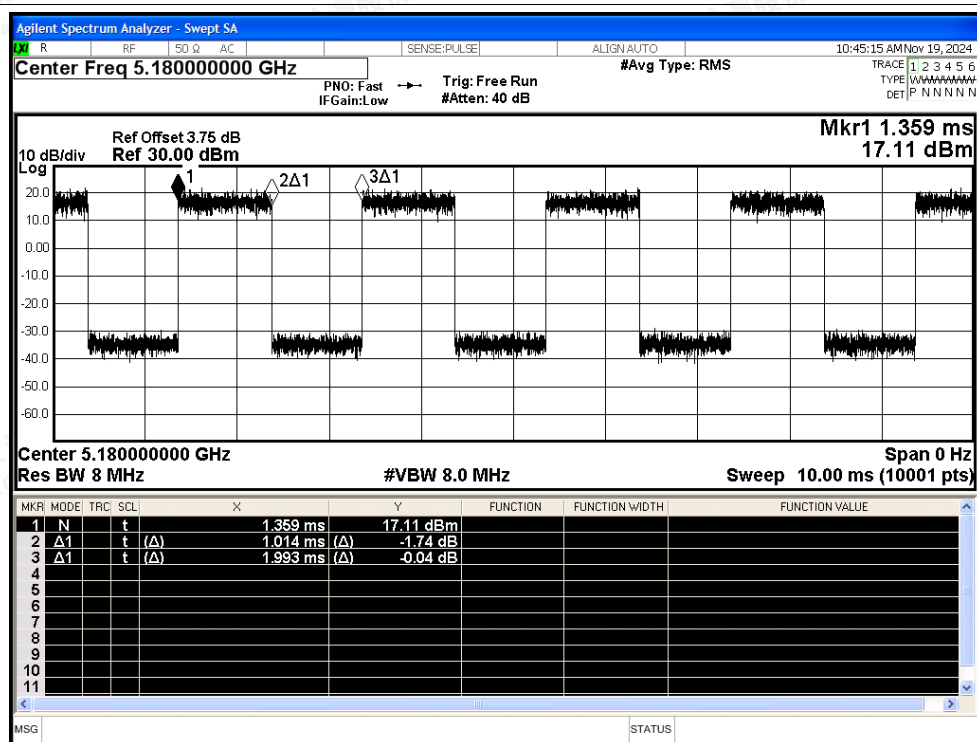

Duty Cycle NVNT ax20 5200MHz Ant6

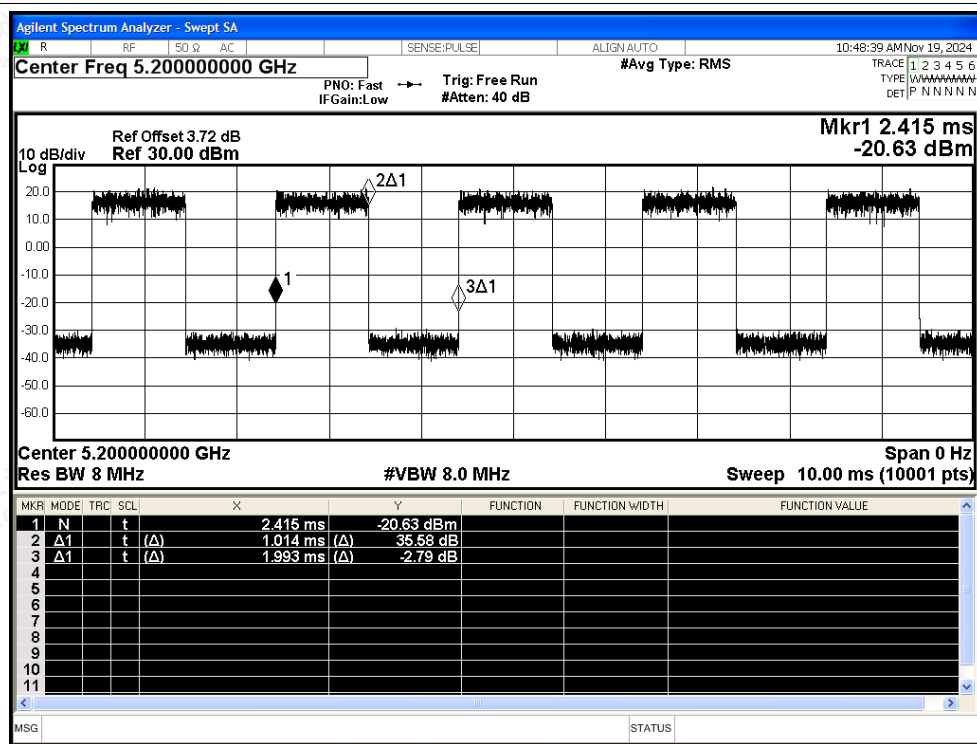

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5240MHz Ant6

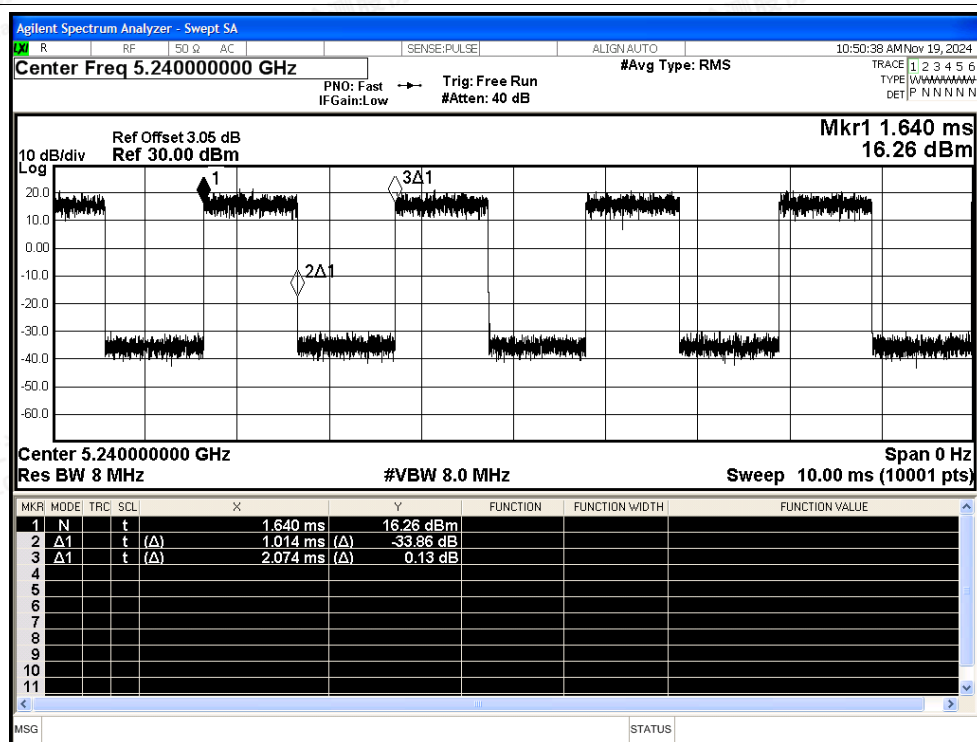

Duty Cycle NVNT ax40 5190MHz Ant6

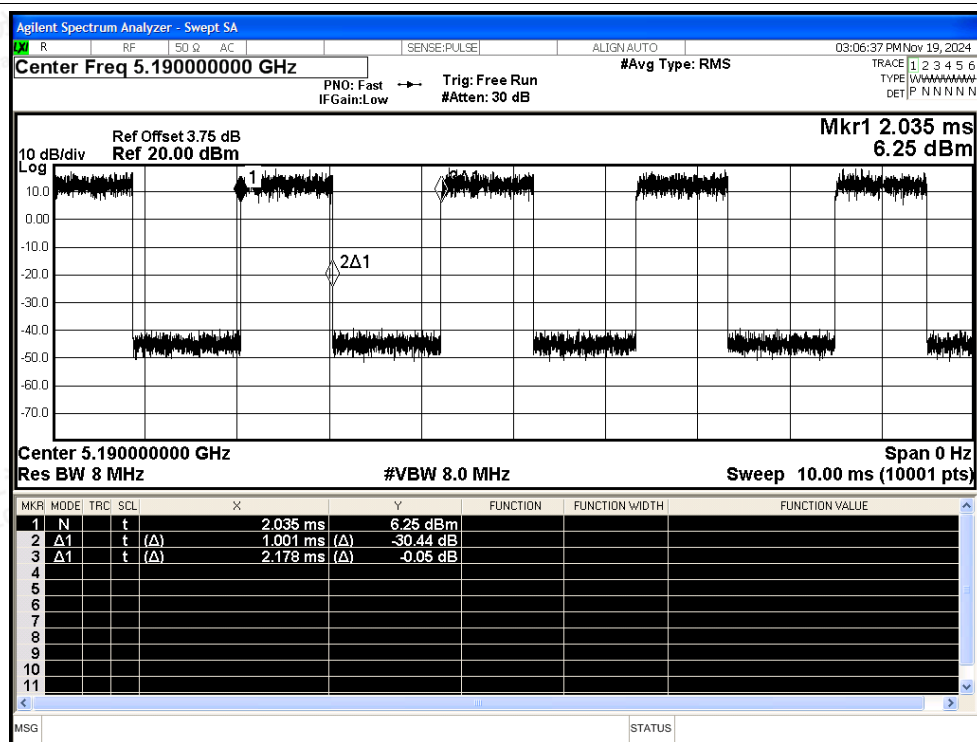

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant6

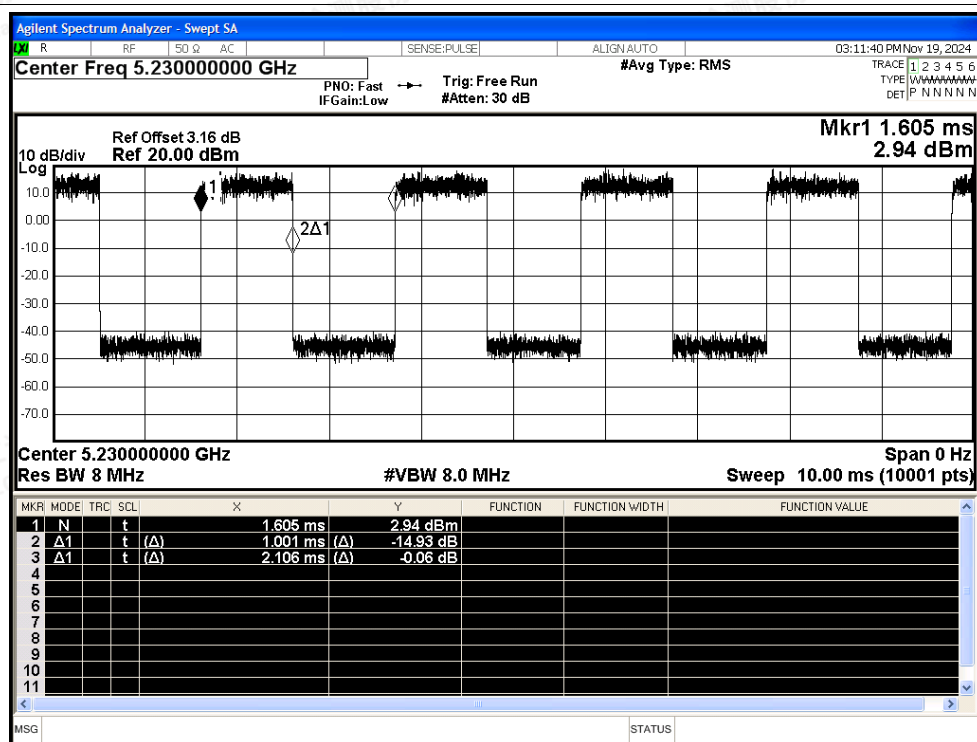

Duty Cycle NVNT ax80 5210MHz Ant6

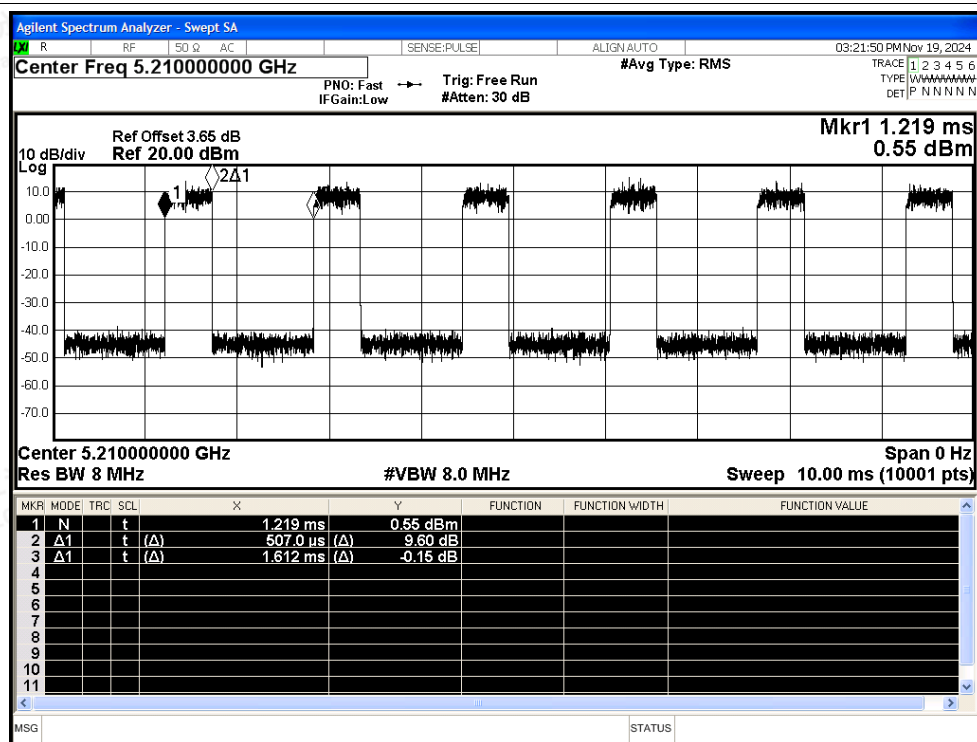

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant7	58.73	2.31	0.72
NVNT	a	5200	Ant7	58.73	2.31	0.72
NVNT	a	5240	Ant7	58.46	2.33	0.72
NVNT	n20	5180	Ant7	54.69	2.62	0.77
NVNT	n20	5200	Ant7	56.79	2.46	0.77
NVNT	n20	5240	Ant7	57.02	2.44	0.77
NVNT	n40	5190	Ant7	39.44	4.04	1.55
NVNT	n40	5230	Ant7	39.88	3.99	1.55
NVNT	ac20	5180	Ant7	57.17	2.43	0.76
NVNT	ac20	5200	Ant7	56.94	2.45	0.76
NVNT	ac20	5240	Ant7	56.99	2.44	0.76
NVNT	ac40	5190	Ant7	40.01	3.98	1.53
NVNT	ac40	5230	Ant7	39.73	4.01	1.53
NVNT	ac80	5210	Ant7	24.7	6.07	3.09
NVNT	ax20	5180	Ant7	49.54	3.05	0.99
NVNT	ax20	5200	Ant7	50.65	2.95	0.99
NVNT	ax20	5240	Ant7	50.65	2.95	0.99
NVNT	ax40	5190	Ant7	33.5	4.75	1.87
NVNT	ax40	5230	Ant7	35.09	4.55	1.87
NVNT	ax80	5210	Ant7	22.51	6.48	3.48



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant7

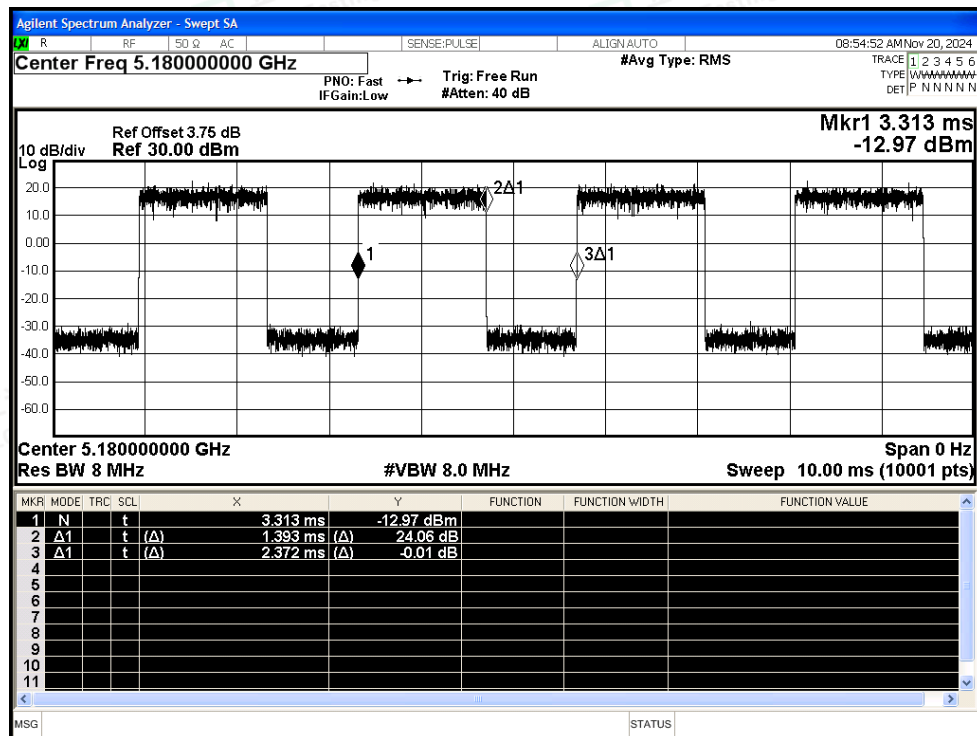

Duty Cycle NVNT a 5200MHz Ant7

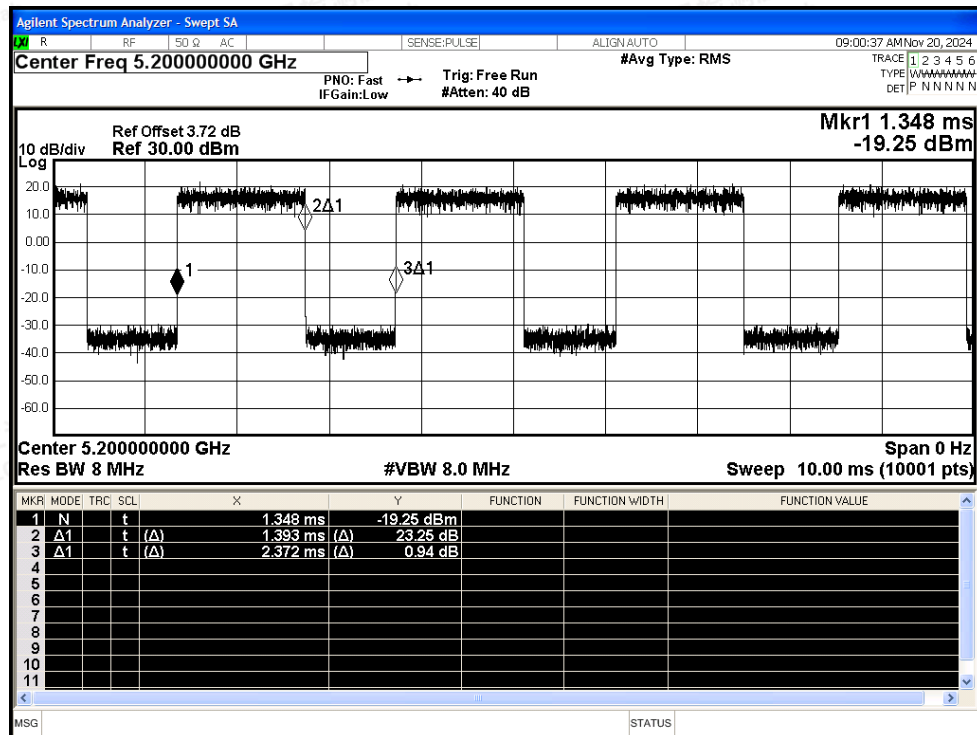

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant7

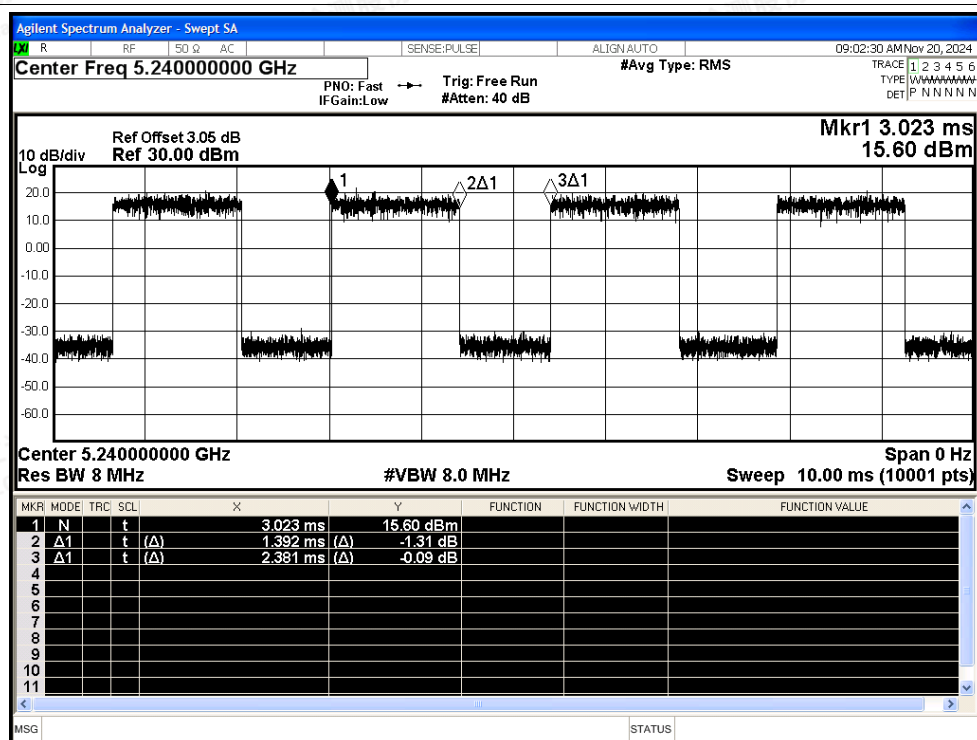

Duty Cycle NVNT n20 5180MHz Ant7

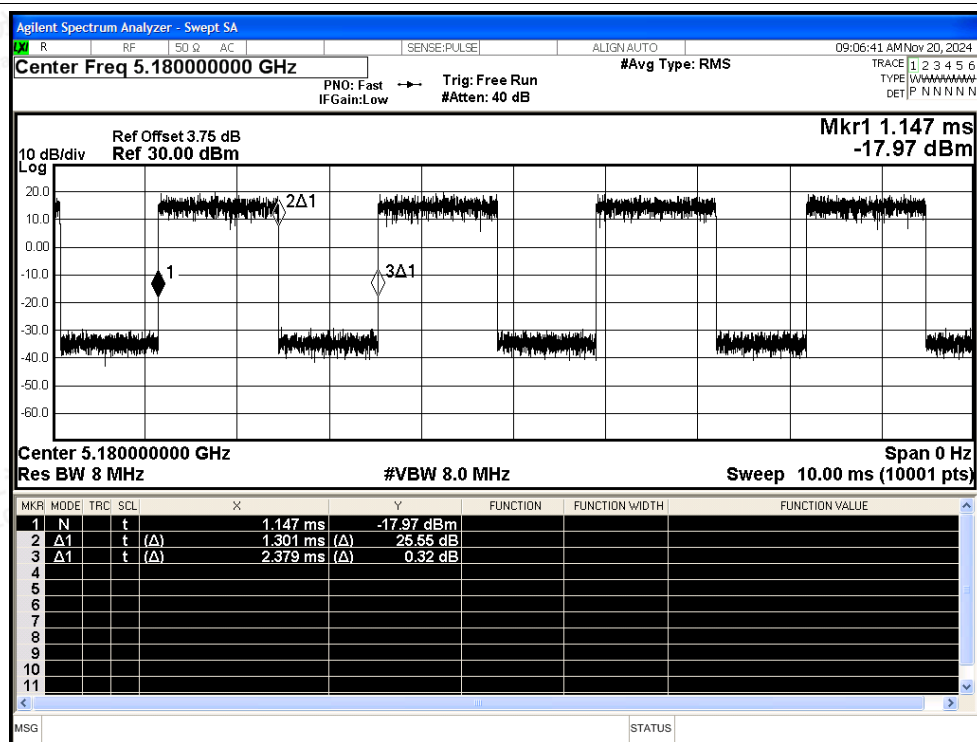

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant7

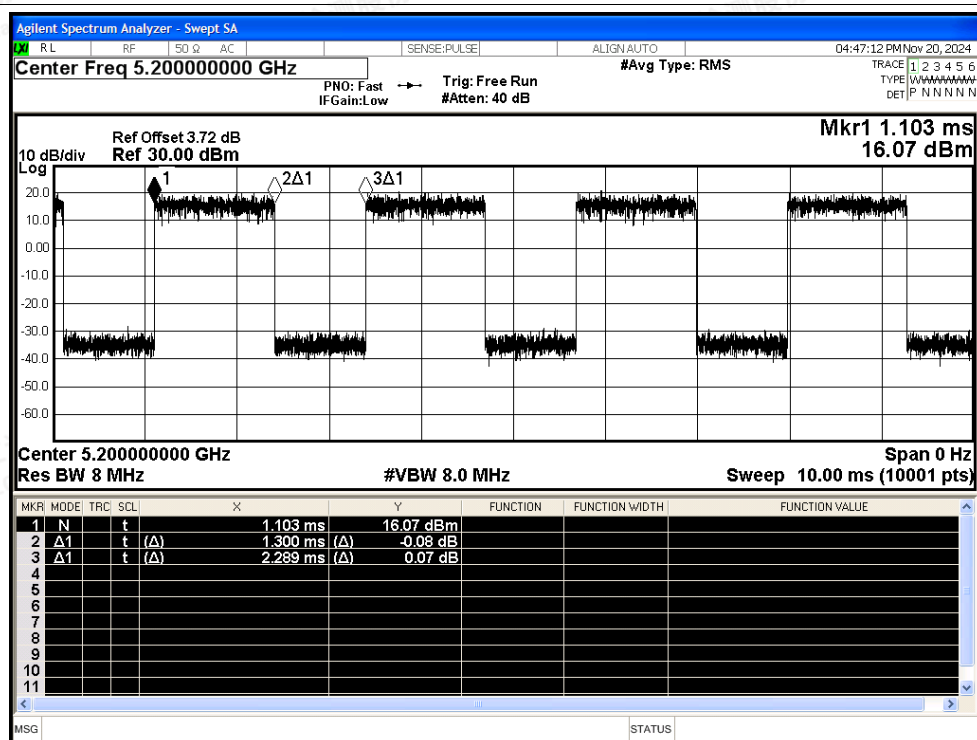

Duty Cycle NVNT n20 5240MHz Ant7

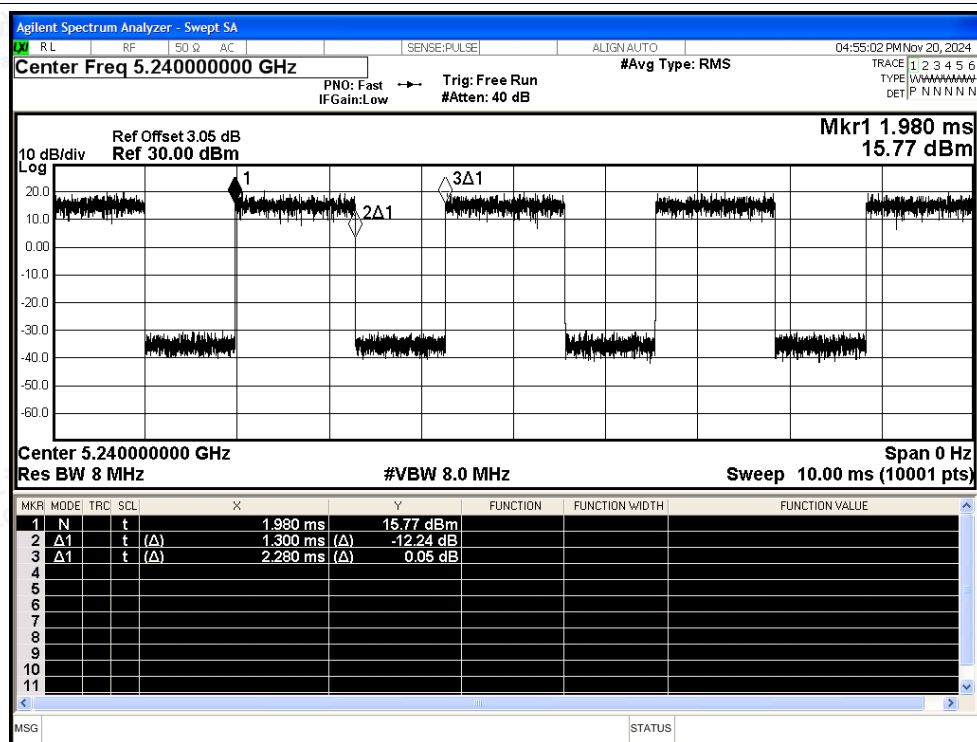

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant7

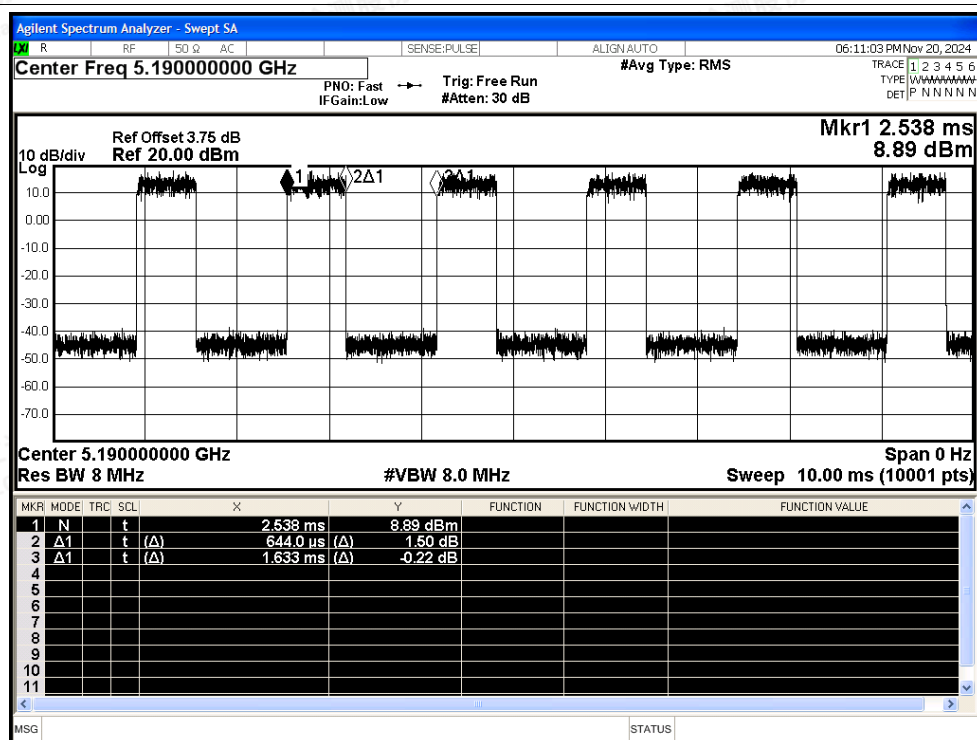

Duty Cycle NVNT n40 5230MHz Ant7

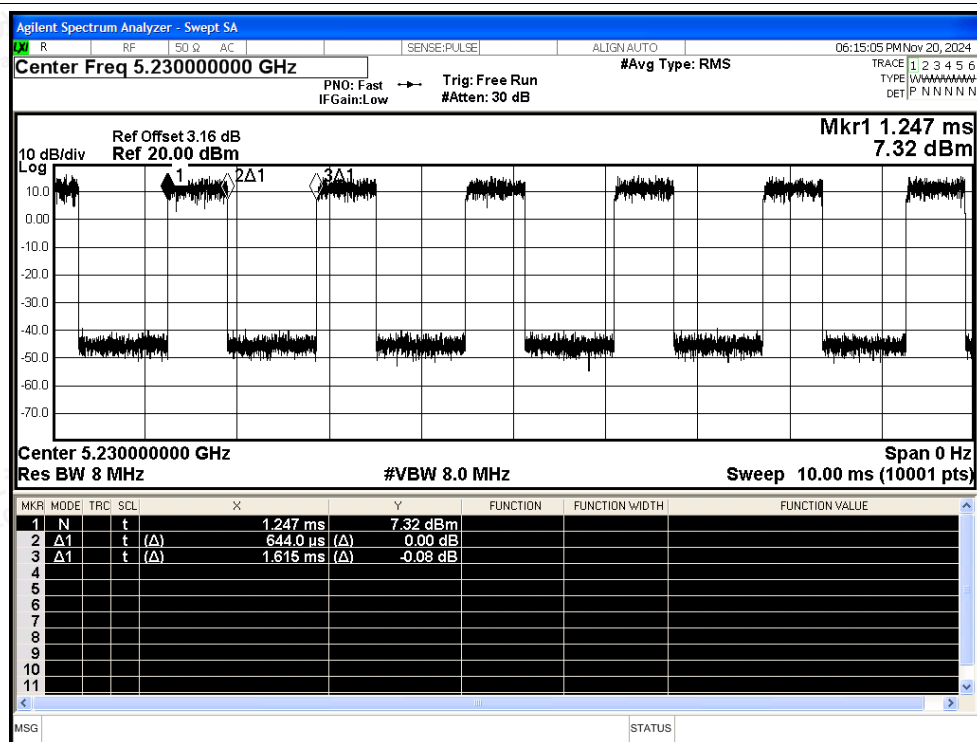

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant7

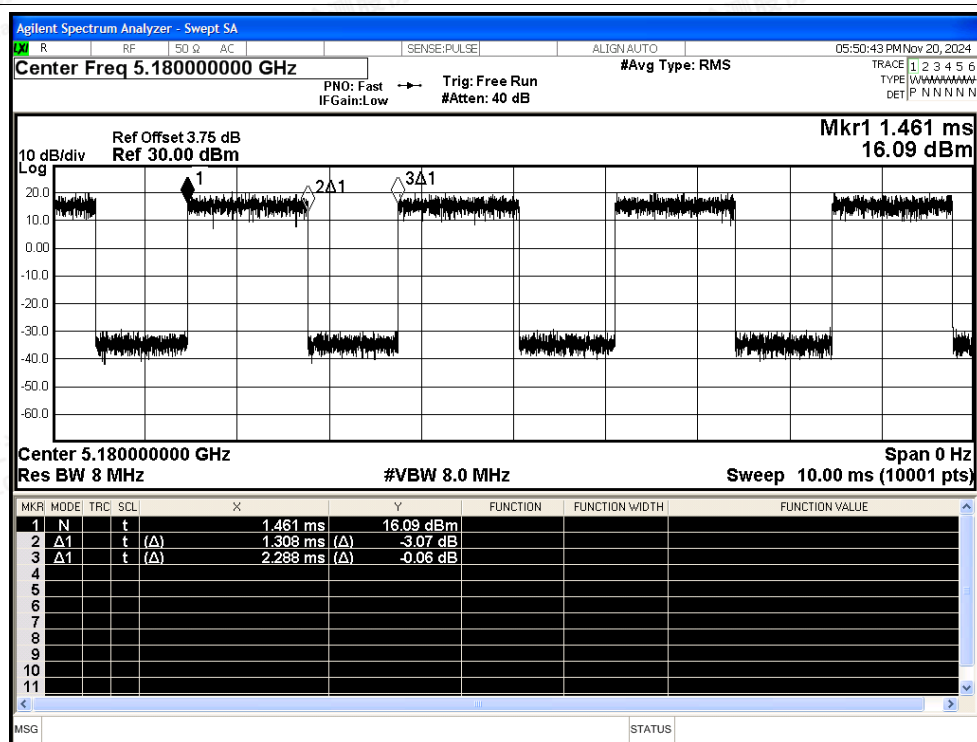

Duty Cycle NVNT ac20 5200MHz Ant7

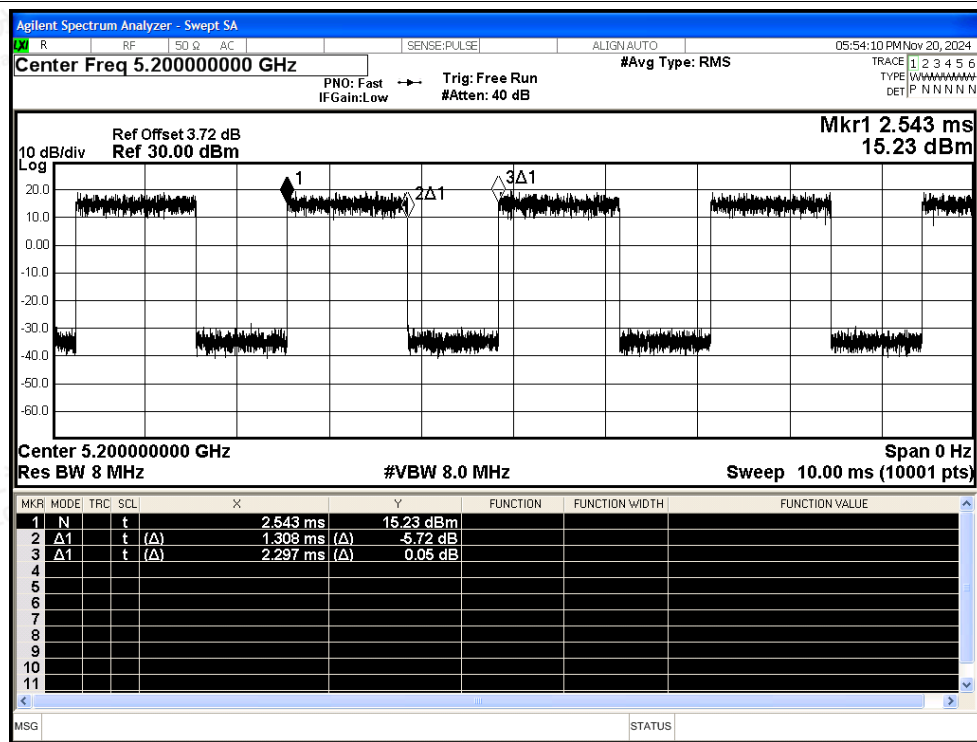

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant7

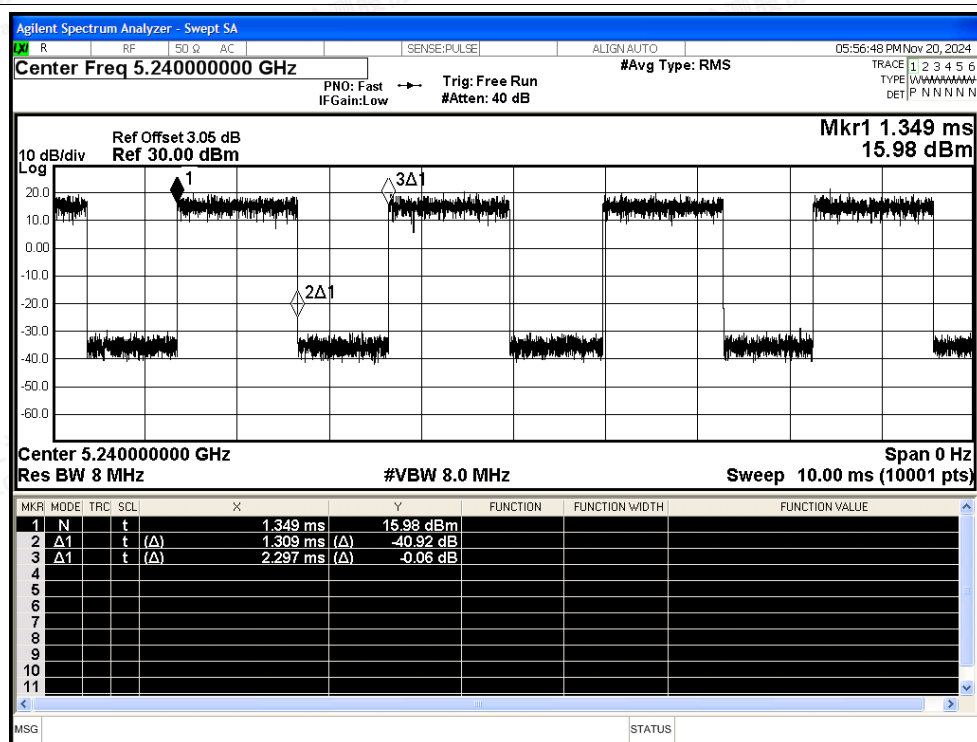

Duty Cycle NVNT ac40 5190MHz Ant7

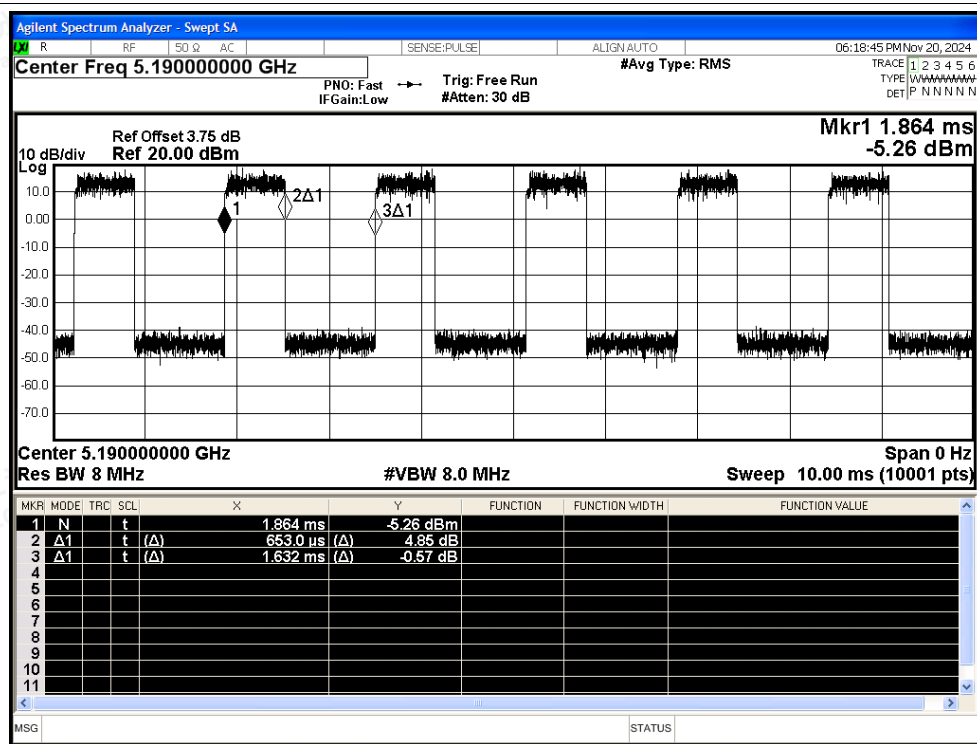

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant7

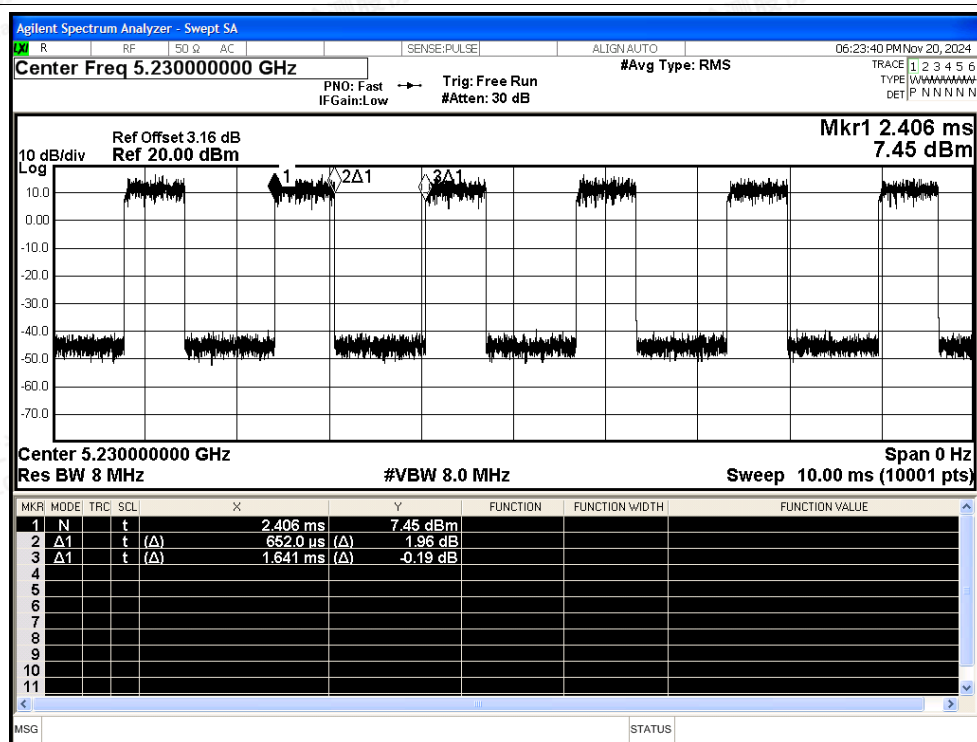

Duty Cycle NVNT ac80 5210MHz Ant7

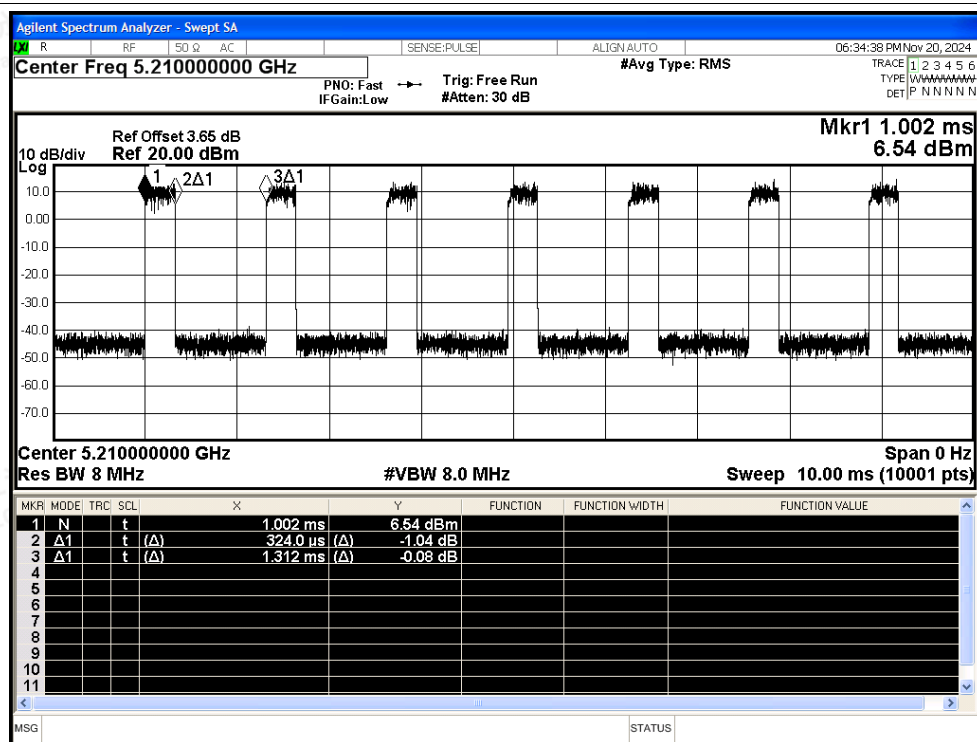

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5180MHz Ant7

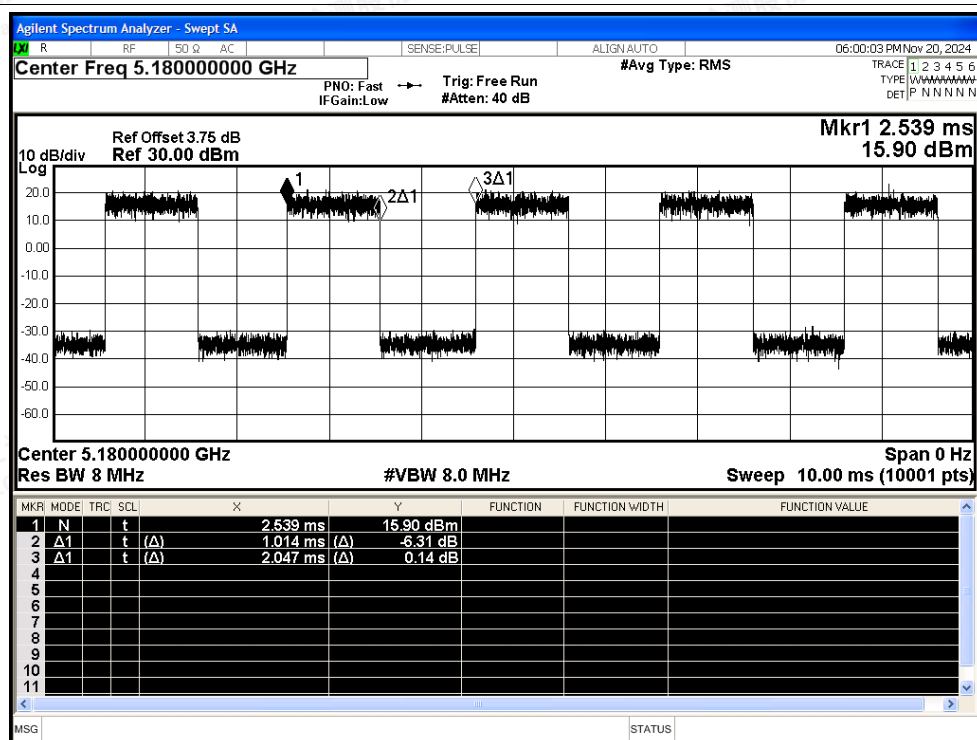

Duty Cycle NVNT ax20 5200MHz Ant7

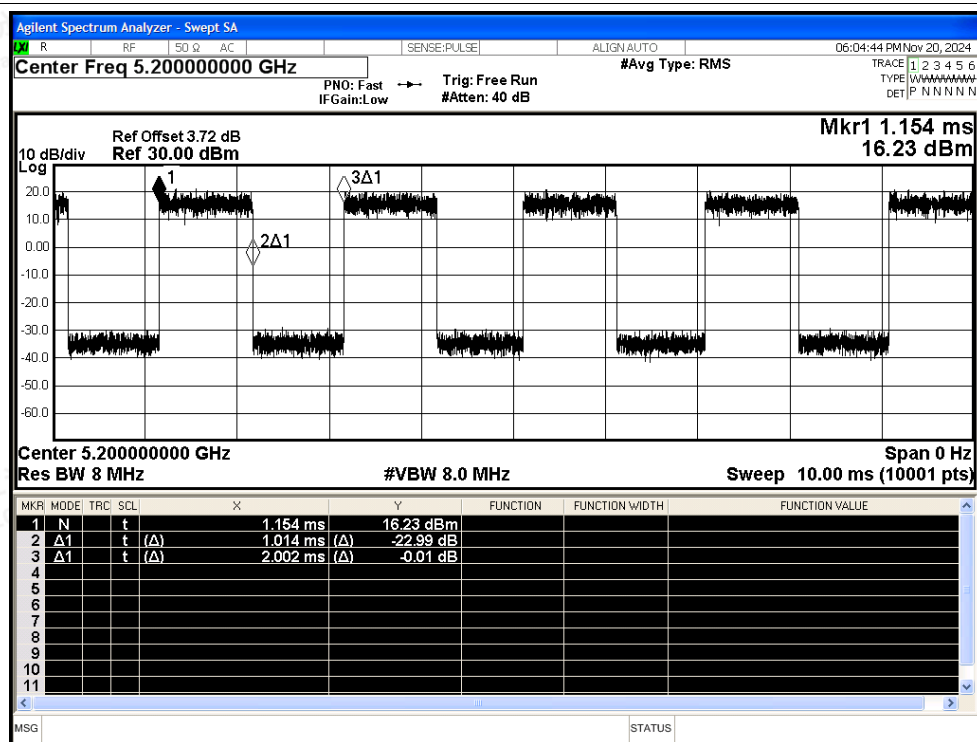

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5240MHz Ant7

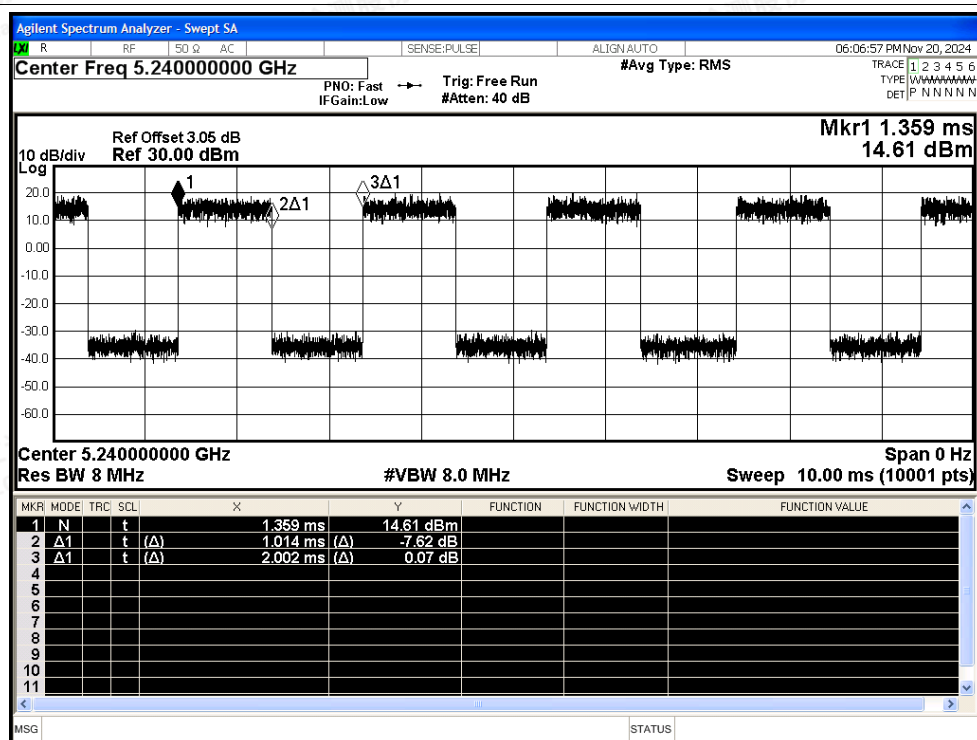

Duty Cycle NVNT ax40 5190MHz Ant7

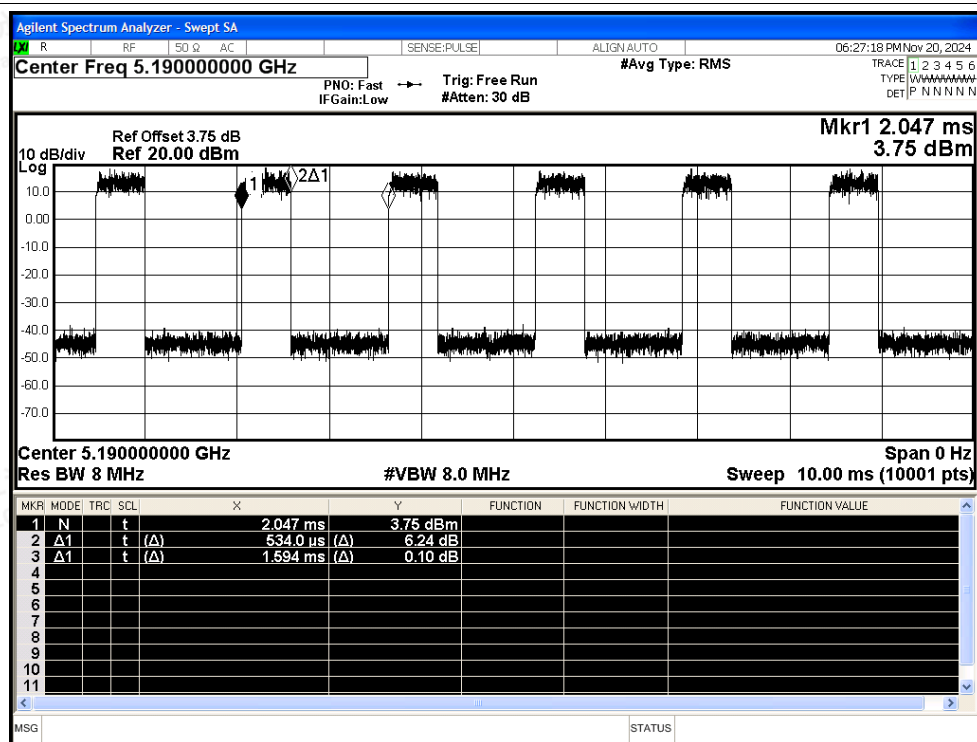

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant7

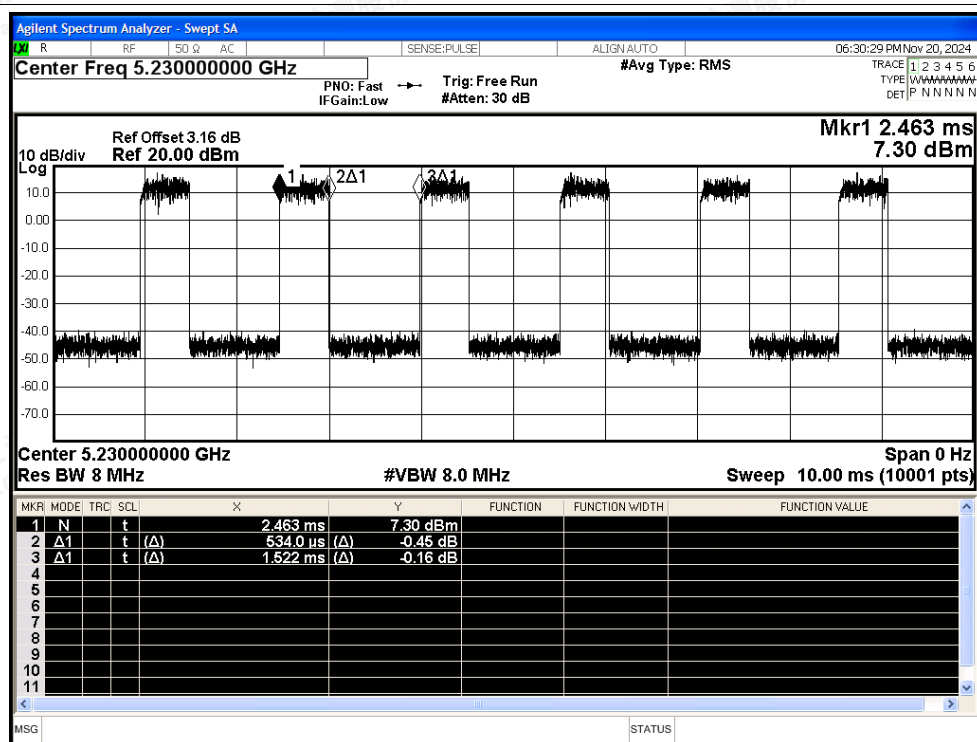

Duty Cycle NVNT ax80 5210MHz Ant7

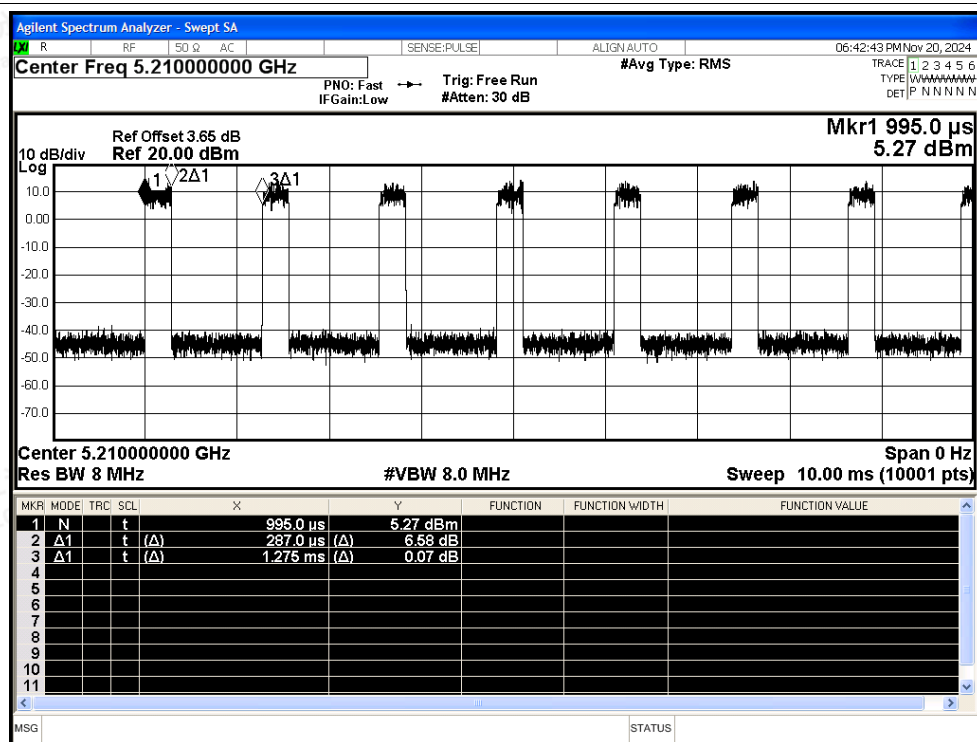

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity