



|      |      |      |      |      |        |   |      |        |         |      |      |
|------|------|------|------|------|--------|---|------|--------|---------|------|------|
| NVNT | n40  | 5755 | Ant7 | 5725 | -45.82 | 2 | 2.6  | -41.22 | Average | 27   | Pass |
| NVNT | n40  | 5795 | Ant7 | 5850 | -46.05 | 2 | -    | -44.05 | Peak    | 27   | Pass |
| NVNT | n40  | 5795 | Ant7 | 5850 | -55.08 | 2 | 2.61 | -50.47 | Average | 27   | Pass |
| NVNT | n40  | 5795 | Ant7 | 5855 | -47.28 | 2 | -    | -45.28 | Peak    | 15.6 | Pass |
| NVNT | n40  | 5795 | Ant7 | 5855 | -55.36 | 2 | 2.61 | -50.75 | Average | 15.6 | Pass |
| NVNT | n40  | 5795 | Ant7 | 5875 | -48.25 | 2 | -    | -46.25 | Peak    | 10   | Pass |
| NVNT | n40  | 5795 | Ant7 | 5875 | -56.62 | 2 | 2.61 | -52.01 | Average | 10   | Pass |
| NVNT | n40  | 5795 | Ant7 | 5925 | -49.76 | 2 | -    | -47.76 | Peak    | -27  | Pass |
| NVNT | n40  | 5795 | Ant7 | 5925 | -57.02 | 2 | 2.61 | -52.41 | Average | -27  | Pass |
| NVNT | ac20 | 5745 | Ant7 | 5650 | -48.44 | 2 | -    | -46.44 | Peak    | -27  | Pass |
| NVNT | ac20 | 5745 | Ant7 | 5650 | -56.23 | 2 | 2.58 | -51.65 | Average | -27  | Pass |
| NVNT | ac20 | 5745 | Ant7 | 5700 | -45.58 | 2 | -    | -43.58 | Peak    | 10   | Pass |
| NVNT | ac20 | 5745 | Ant7 | 5700 | -55.13 | 2 | 2.58 | -50.55 | Average | 10   | Pass |
| NVNT | ac20 | 5745 | Ant7 | 5720 | -33.4  | 2 | -    | -31.4  | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5745 | Ant7 | 5720 | -48.96 | 2 | 2.58 | -44.38 | Average | 15.6 | Pass |
| NVNT | ac20 | 5745 | Ant7 | 5725 | -36.64 | 2 | -    | -34.64 | Peak    | 27   | Pass |
| NVNT | ac20 | 5745 | Ant7 | 5725 | -47.13 | 2 | 2.58 | -42.55 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | Ant7 | 5850 | -39.86 | 2 | -    | -37.86 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | Ant7 | 5850 | -51.68 | 2 | 2.45 | -47.23 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | Ant7 | 5855 | -43.23 | 2 | -    | -41.23 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | Ant7 | 5855 | -53.57 | 2 | 2.45 | -49.12 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | Ant7 | 5875 | -48.81 | 2 | -    | -46.81 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | Ant7 | 5875 | -56.76 | 2 | 2.45 | -52.31 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | Ant7 | 5925 | -49.78 | 2 | -    | -47.78 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | Ant7 | 5925 | -56.65 | 2 | 2.45 | -52.2  | Average | -27  | Pass |
| NVNT | ac40 | 5755 | Ant7 | 5650 | -46.56 | 2 | -    | -44.56 | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | Ant7 | 5650 | -56.18 | 2 | 2.71 | -51.47 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | Ant7 | 5700 | -42.58 | 2 | -    | -40.58 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | Ant7 | 5700 | -54    | 2 | 2.71 | -49.29 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | Ant7 | 5720 | -36.37 | 2 | -    | -34.37 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | Ant7 | 5720 | -48.01 | 2 | 2.71 | -43.3  | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | Ant7 | 5725 | -30.41 | 2 | -    | -28.41 | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | Ant7 | 5725 | -46.73 | 2 | 2.71 | -42.02 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | Ant7 | 5850 | -46.22 | 2 | -    | -44.22 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | Ant7 | 5850 | -55.78 | 2 | 2.5  | -51.28 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | Ant7 | 5855 | -47.64 | 2 | -    | -45.64 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5795 | Ant7 | 5855 | -55.69 | 2 | 2.5  | -51.19 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | Ant7 | 5875 | -46.69 | 2 | -    | -44.69 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | Ant7 | 5875 | -56.66 | 2 | 2.5  | -52.16 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | Ant7 | 5925 | -47.91 | 2 | -    | -45.91 | Peak    | -27  | Pass |
| NVNT | ac40 | 5795 | Ant7 | 5925 | -57.21 | 2 | 2.5  | -52.71 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5850 | -38.6  | 2 | -    | -36.6  | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5850 | -49.13 | 2 | 2.86 | -44.27 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |   |      |        |         |      |      |
|------|------|------|------|------|--------|---|------|--------|---------|------|------|
| NVNT | ac80 | 5775 | Ant7 | 5855 | -39.78 | 2 | -    | -37.78 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5855 | -50.16 | 2 | 2.86 | -45.3  | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5875 | -42.98 | 2 | -    | -40.98 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5875 | -55.4  | 2 | 2.86 | -50.54 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5925 | -48.57 | 2 | -    | -46.57 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5925 | -56.72 | 2 | 2.86 | -51.86 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5650 | -47.95 | 2 | -    | -45.95 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5650 | -55.02 | 2 | 2.86 | -50.16 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5700 | -36.59 | 2 | -    | -34.59 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5700 | -47.78 | 2 | 2.86 | -42.92 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5720 | -35.53 | 2 | -    | -33.53 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5720 | -46.15 | 2 | 2.86 | -41.29 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5725 | -34.63 | 2 | -    | -32.63 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | Ant7 | 5725 | -46.07 | 2 | 2.86 | -41.21 | Average | 27   | Pass |
| NVNT | ax20 | 5745 | Ant7 | 5650 | -49.31 | 2 | -    | -47.31 | Peak    | -27  | Pass |
| NVNT | ax20 | 5745 | Ant7 | 5650 | -57.04 | 2 | 2.95 | -52.09 | Average | -27  | Pass |
| NVNT | ax20 | 5745 | Ant7 | 5700 | -48.31 | 2 | -    | -46.31 | Peak    | 10   | Pass |
| NVNT | ax20 | 5745 | Ant7 | 5700 | -55.47 | 2 | 2.95 | -50.52 | Average | 10   | Pass |
| NVNT | ax20 | 5745 | Ant7 | 5720 | -45.14 | 2 | -    | -43.14 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5745 | Ant7 | 5720 | -53.41 | 2 | 2.95 | -48.46 | Average | 15.6 | Pass |
| NVNT | ax20 | 5745 | Ant7 | 5725 | -40.13 | 2 | -    | -38.13 | Peak    | 27   | Pass |
| NVNT | ax20 | 5745 | Ant7 | 5725 | -50.8  | 2 | 2.95 | -45.85 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | Ant7 | 5850 | -34.55 | 2 | -    | -32.55 | Peak    | 27   | Pass |
| NVNT | ax20 | 5825 | Ant7 | 5850 | -52.29 | 2 | 2.95 | -47.34 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | Ant7 | 5855 | -39.81 | 2 | -    | -37.81 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5825 | Ant7 | 5855 | -54.15 | 2 | 2.95 | -49.2  | Average | 15.6 | Pass |
| NVNT | ax20 | 5825 | Ant7 | 5875 | -49.11 | 2 | -    | -47.11 | Peak    | 10   | Pass |
| NVNT | ax20 | 5825 | Ant7 | 5875 | -56.41 | 2 | 2.95 | -51.46 | Average | 10   | Pass |
| NVNT | ax20 | 5825 | Ant7 | 5925 | -48.61 | 2 | -    | -46.61 | Peak    | -27  | Pass |
| NVNT | ax20 | 5825 | Ant7 | 5925 | -56.87 | 2 | 2.95 | -51.92 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | Ant7 | 5650 | -47.85 | 2 | -    | -45.85 | Peak    | -27  | Pass |
| NVNT | ax40 | 5755 | Ant7 | 5650 | -56.31 | 2 | 3.02 | -51.29 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | Ant7 | 5700 | -44.76 | 2 | -    | -42.76 | Peak    | 10   | Pass |
| NVNT | ax40 | 5755 | Ant7 | 5700 | -55.75 | 2 | 3.02 | -50.73 | Average | 10   | Pass |
| NVNT | ax40 | 5755 | Ant7 | 5720 | -44.24 | 2 | -    | -42.24 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5755 | Ant7 | 5720 | -53.61 | 2 | 3.02 | -48.59 | Average | 15.6 | Pass |
| NVNT | ax40 | 5755 | Ant7 | 5725 | -40.31 | 2 | -    | -38.31 | Peak    | 27   | Pass |
| NVNT | ax40 | 5755 | Ant7 | 5725 | -51.77 | 2 | 3.02 | -46.75 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | Ant7 | 5850 | -45.01 | 2 | -    | -43.01 | Peak    | 27   | Pass |
| NVNT | ax40 | 5795 | Ant7 | 5850 | -56.57 | 2 | 3.1  | -51.47 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | Ant7 | 5855 | -46.69 | 2 | -    | -44.69 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5795 | Ant7 | 5855 | -57.16 | 2 | 3.1  | -52.06 | Average | 15.6 | Pass |
| NVNT | ax40 | 5795 | Ant7 | 5875 | -50.01 | 2 | -    | -48.01 | Peak    | 10   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




|      |      |      |      |      |        |   |      |        |         |      |      |
|------|------|------|------|------|--------|---|------|--------|---------|------|------|
| NVNT | ax40 | 5795 | Ant7 | 5875 | -57.24 | 2 | 3.1  | -52.14 | Average | 10   | Pass |
| NVNT | ax40 | 5795 | Ant7 | 5925 | -48.33 | 2 | -    | -46.33 | Peak    | -27  | Pass |
| NVNT | ax40 | 5795 | Ant7 | 5925 | -56.59 | 2 | 3.1  | -51.49 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5850 | -45.19 | 2 | -    | -43.19 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5850 | -54.62 | 2 | 3.28 | -49.34 | Average | 27   | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5855 | -42.83 | 2 | -    | -40.83 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5855 | -54.29 | 2 | 3.28 | -49.01 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5875 | -45.69 | 2 | -    | -43.69 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5875 | -55.52 | 2 | 3.28 | -50.24 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5925 | -49.31 | 2 | -    | -47.31 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5925 | -56.79 | 2 | 3.28 | -51.51 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5650 | -48.53 | 2 | -    | -46.53 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5650 | -56.72 | 2 | 3.28 | -51.44 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5700 | -45.81 | 2 | -    | -43.81 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5700 | -54.83 | 2 | 3.28 | -49.55 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5720 | -43.8  | 2 | -    | -41.8  | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5720 | -52.79 | 2 | 3.28 | -47.51 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5725 | -41.71 | 2 | -    | -39.71 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | Ant7 | 5725 | -51.8  | 2 | 3.28 | -46.52 | Average | 27   | Pass |






## Test Graphs

## Restrict Band NVNT a 5745MHz Ant7 Peak

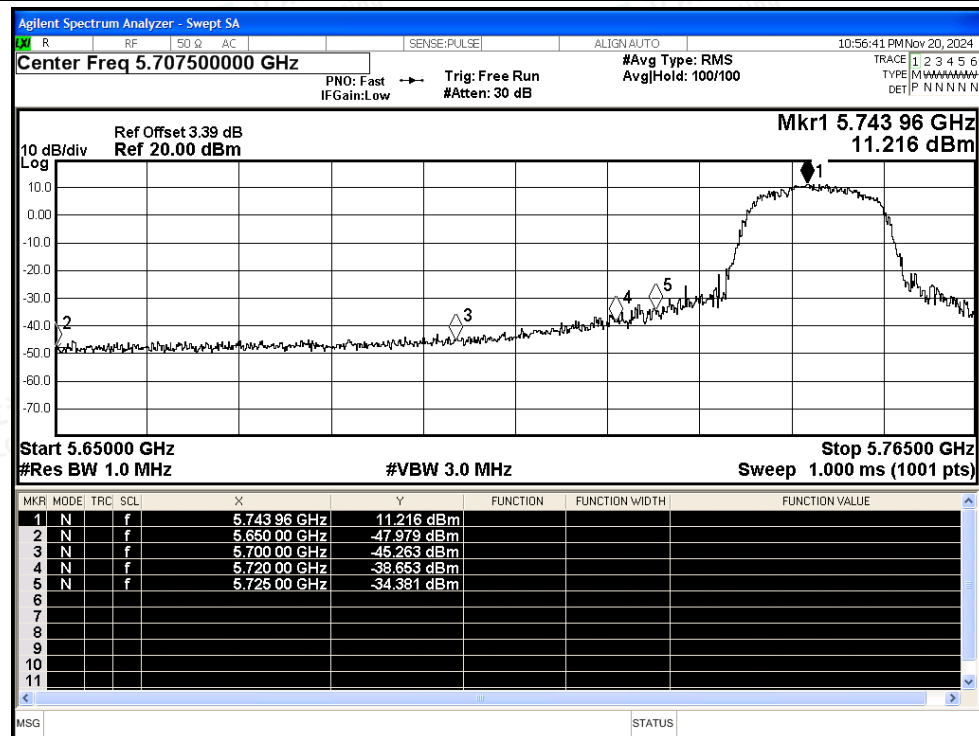

## Restrict Band NVNT a 5745MHz Ant7 Average

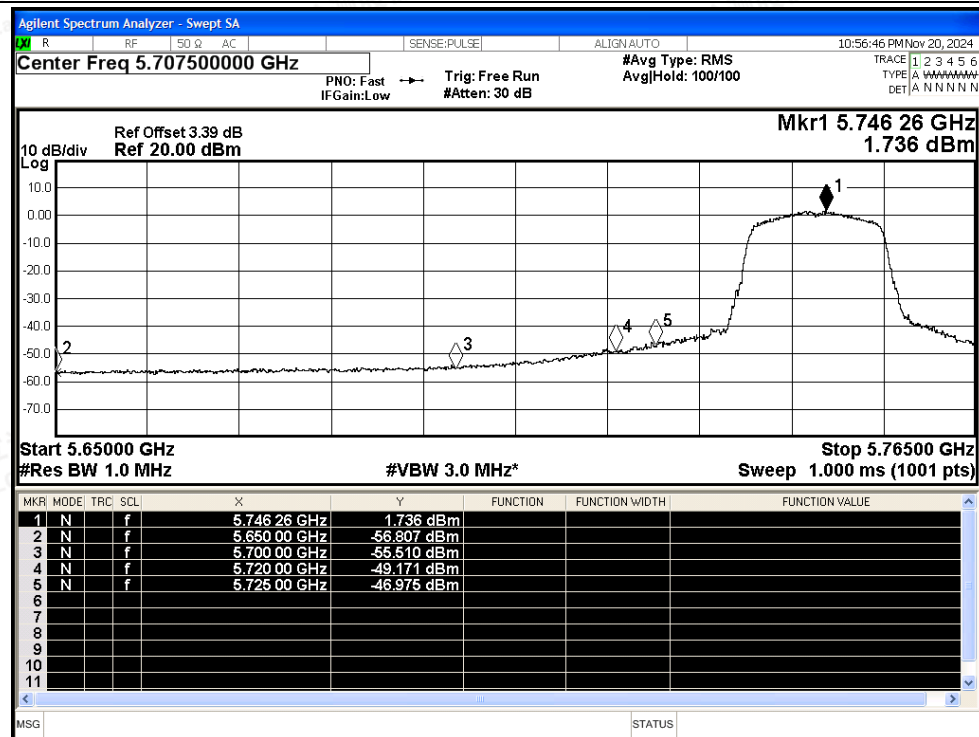

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT a 5825MHz Ant7 Peak

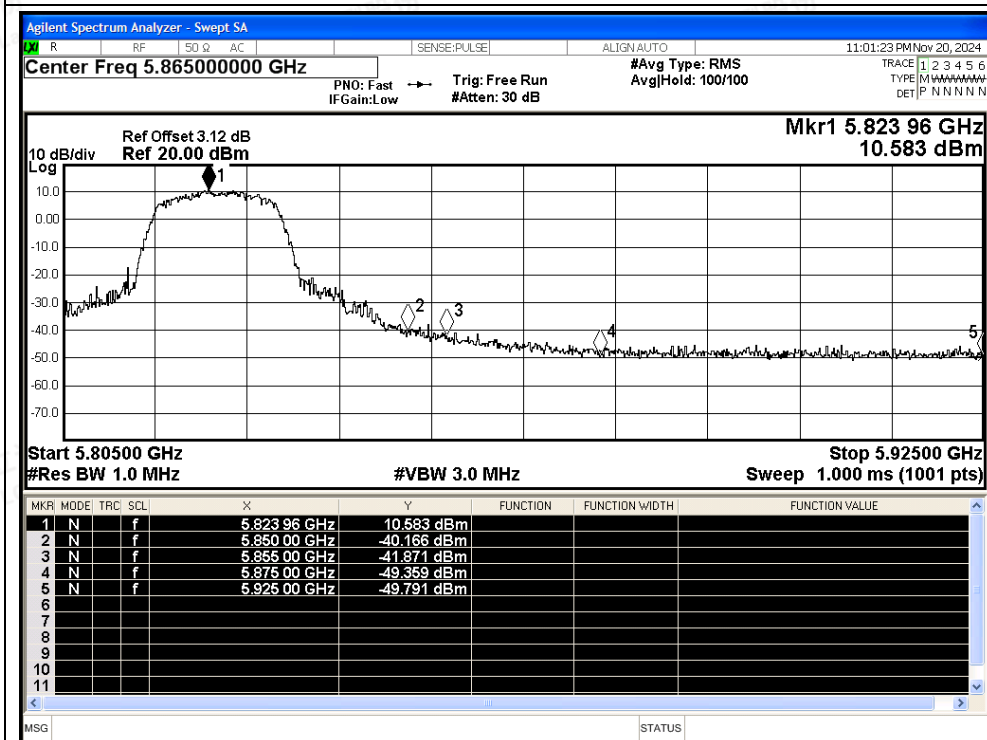

## Restrict Band NVNT a 5825MHz Ant7 Average


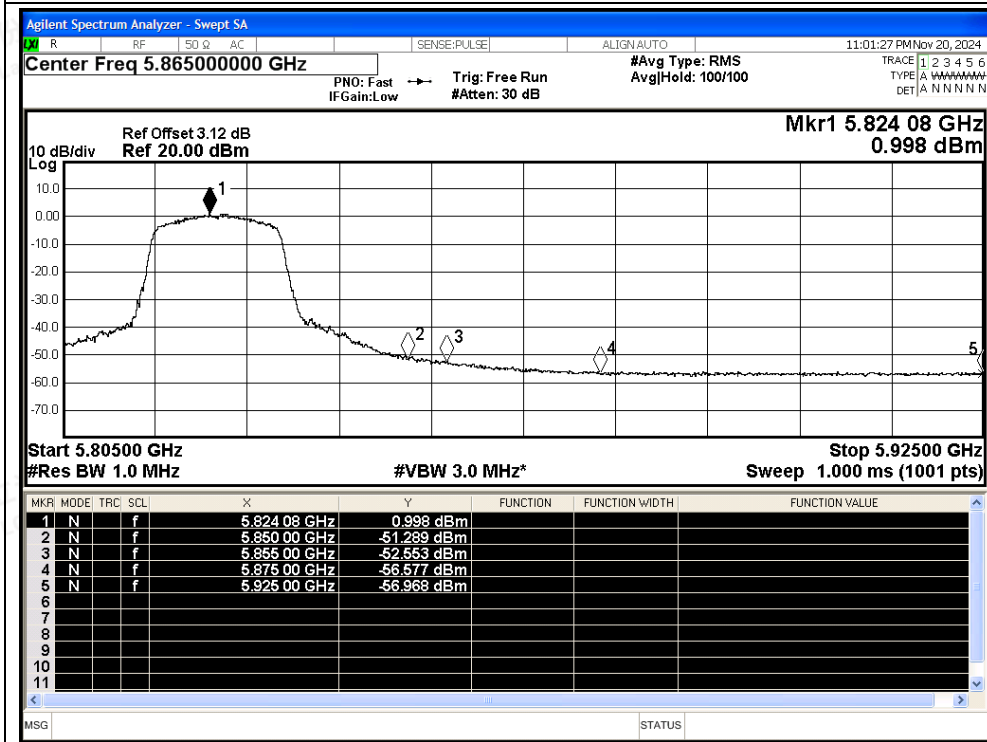


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

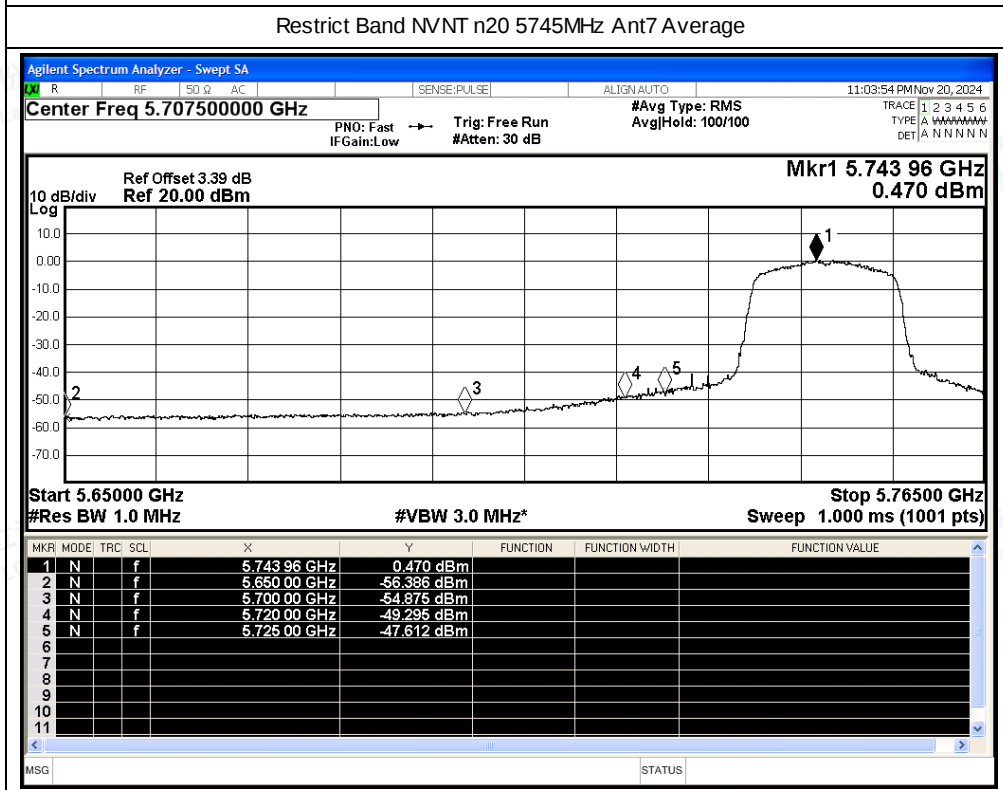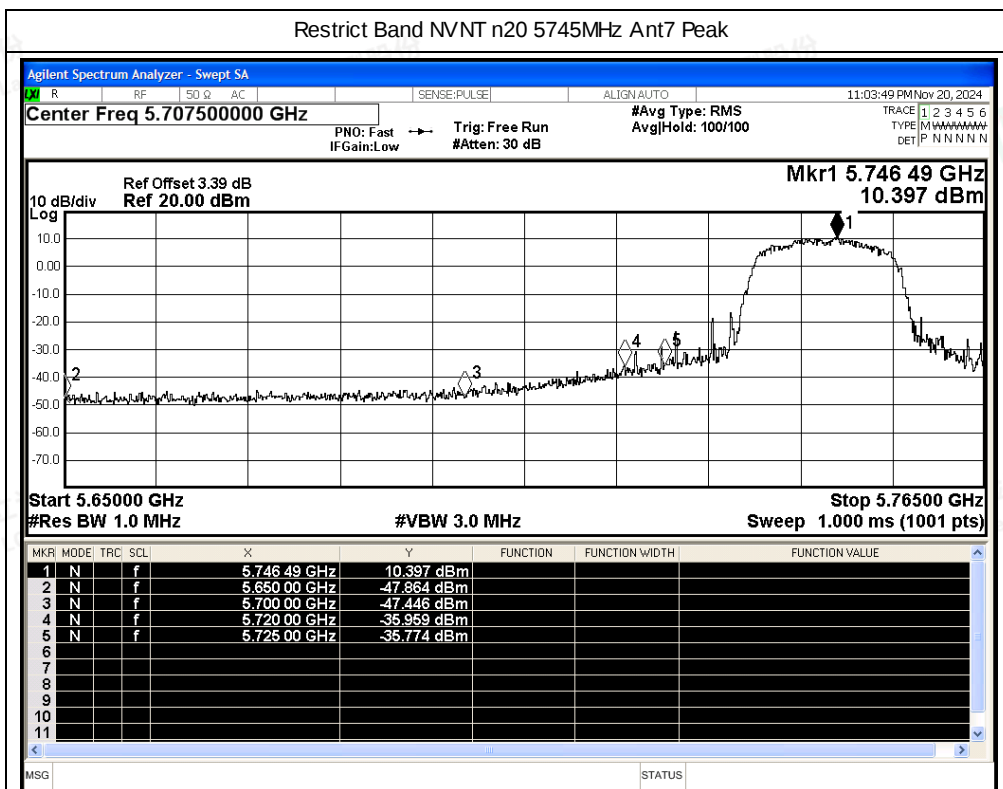




## Restrict Band NVNT n20 5825MHz Ant7 Peak

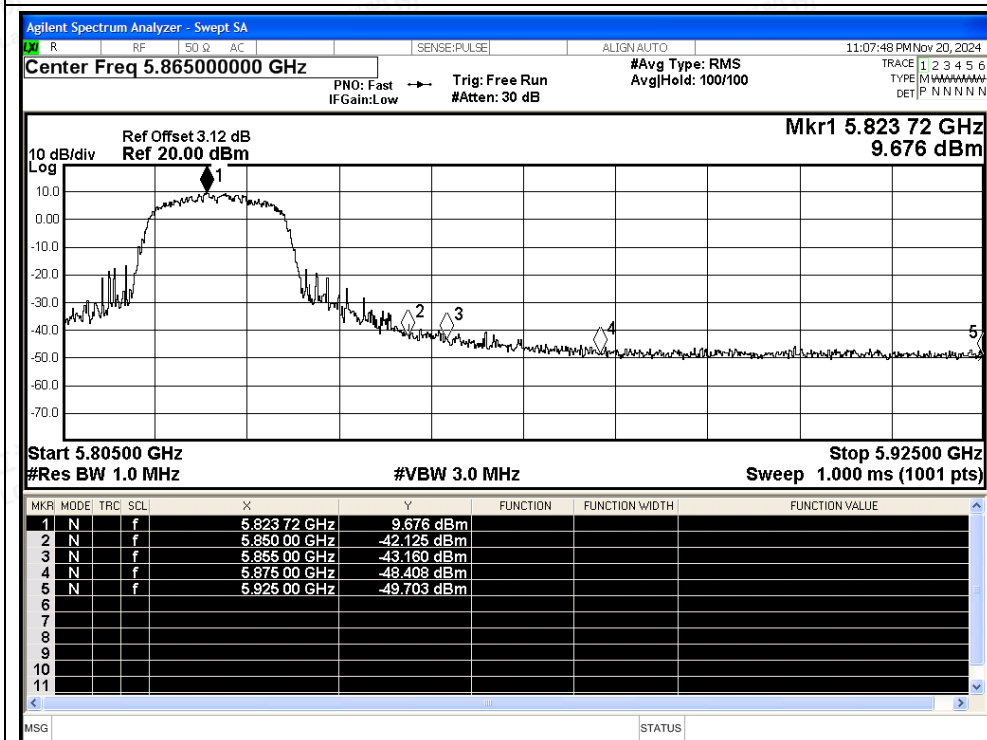

## Restrict Band NVNT n20 5825MHz Ant7 Average

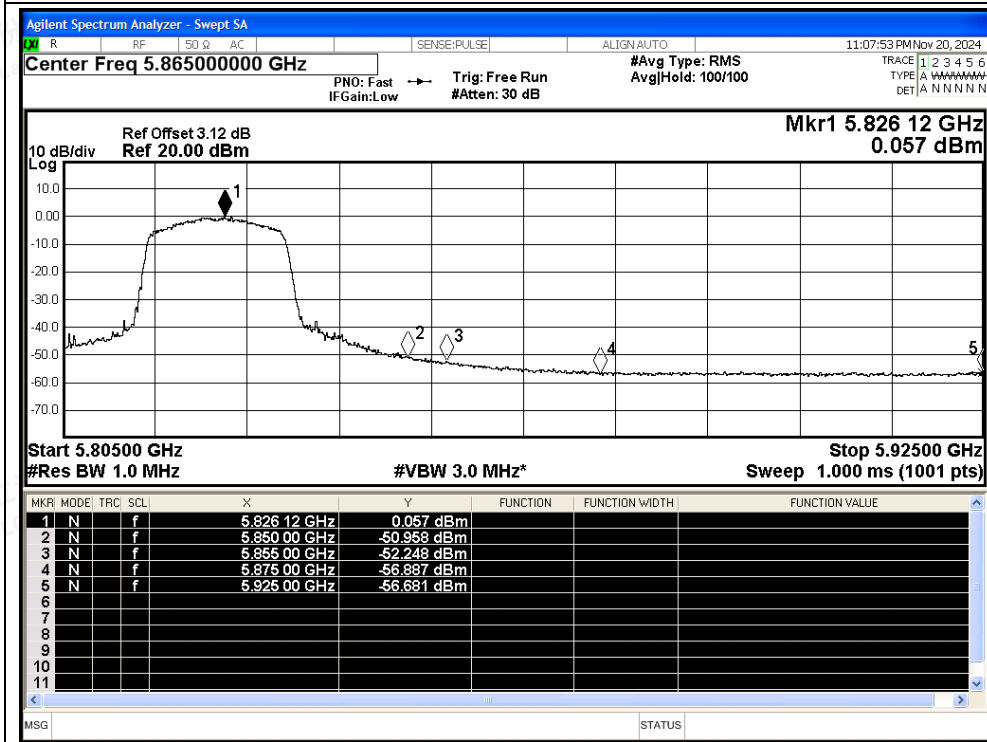

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5755MHz Ant7 Peak

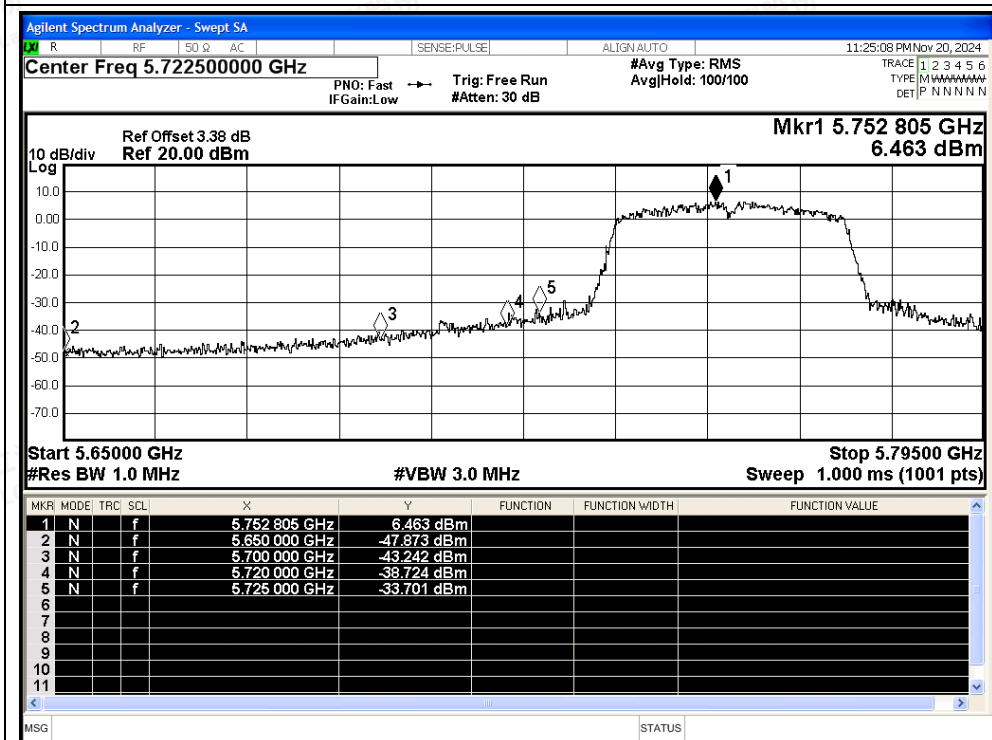

## Restrict Band NVNT n40 5755MHz Ant7 Average

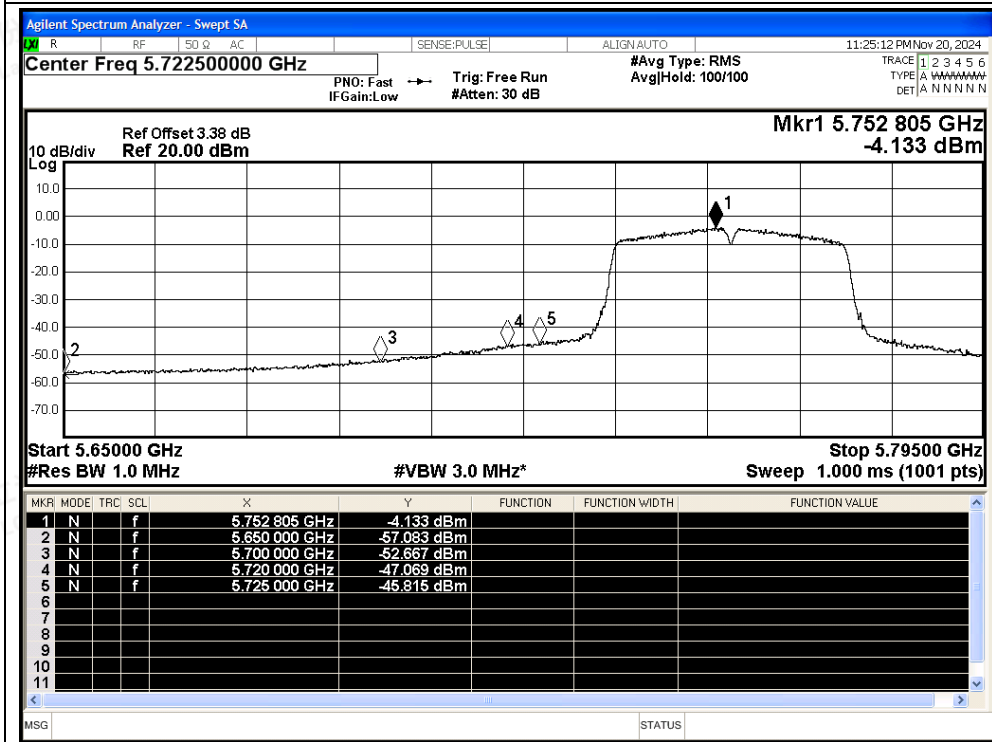

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5795MHz Ant7 Peak

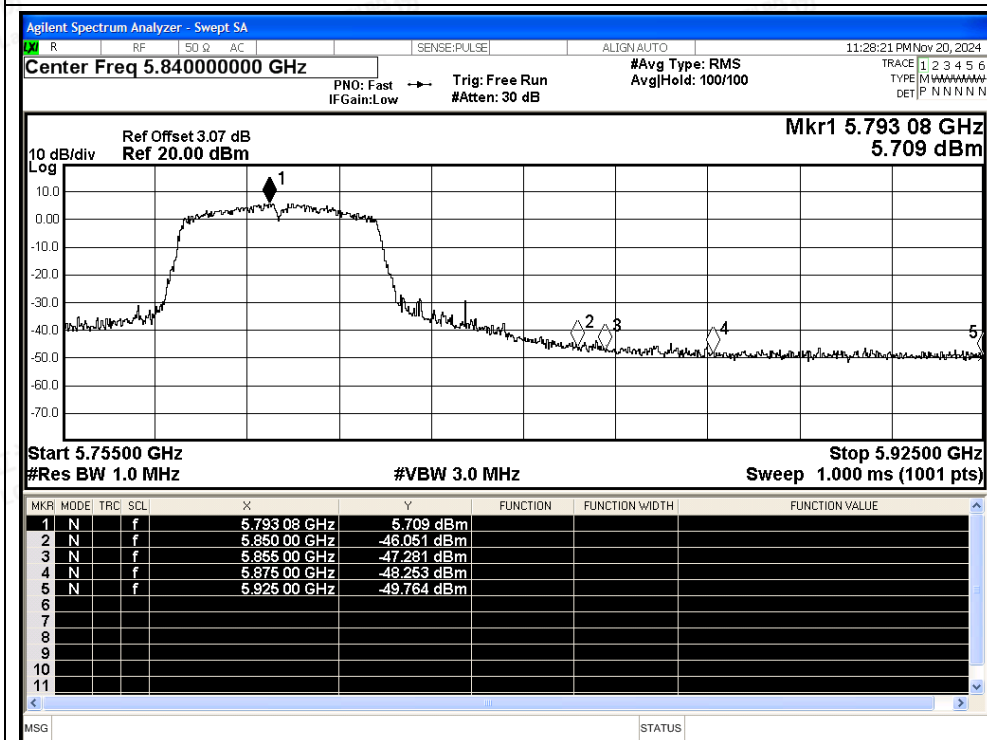

## Restrict Band NVNT n40 5795MHz Ant7 Average


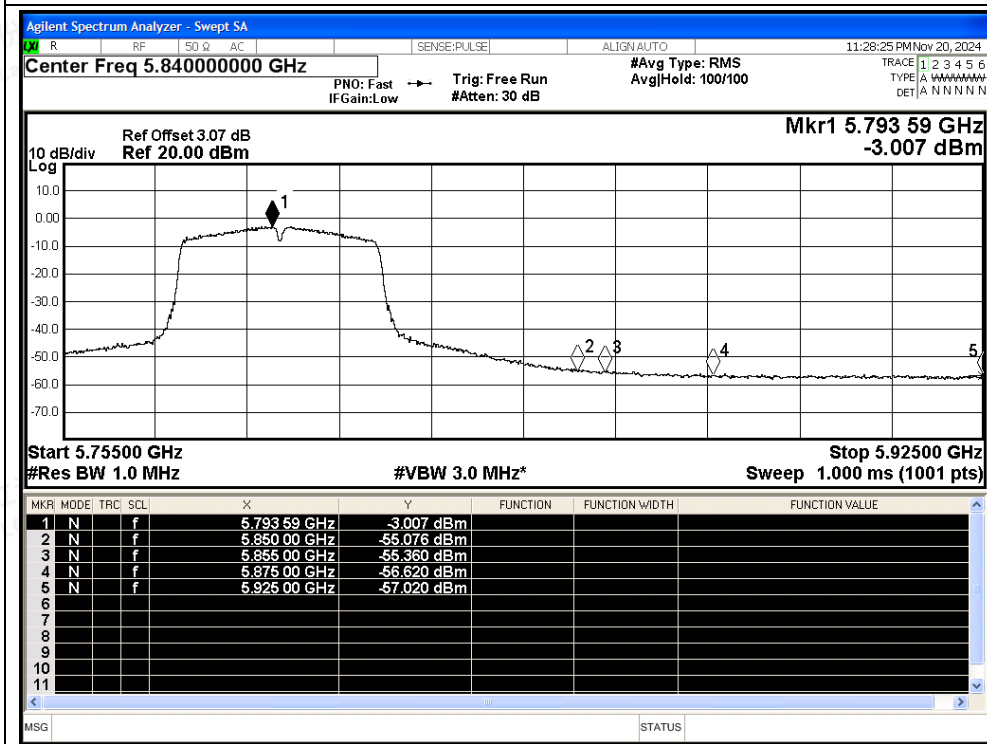


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

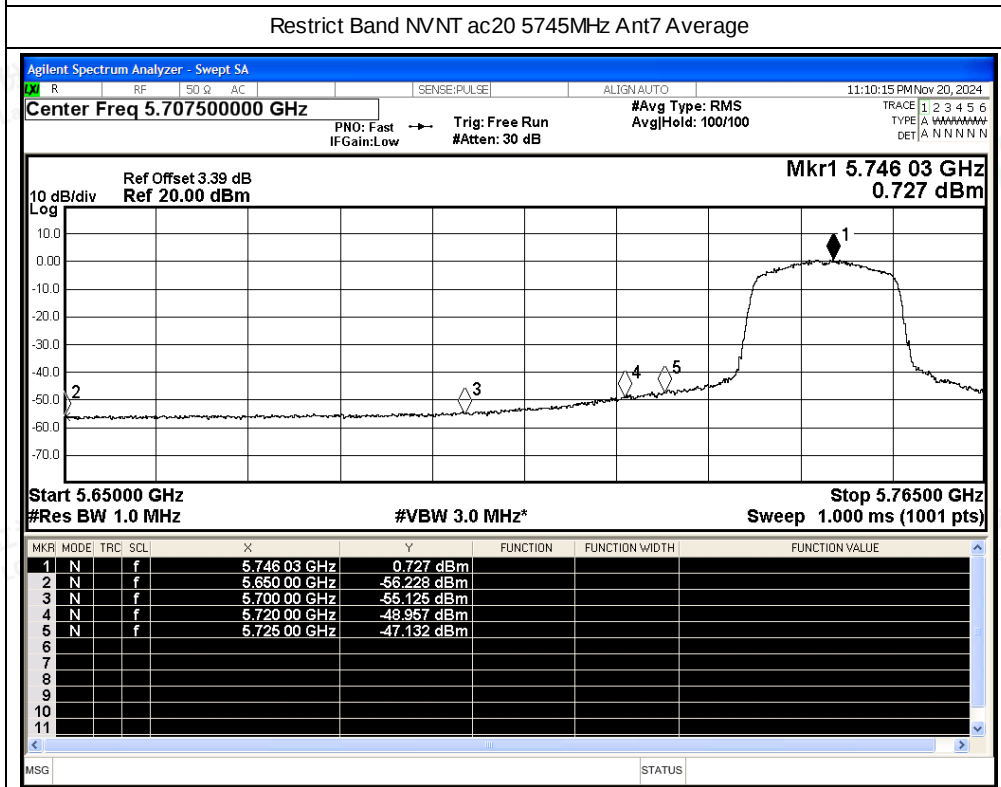
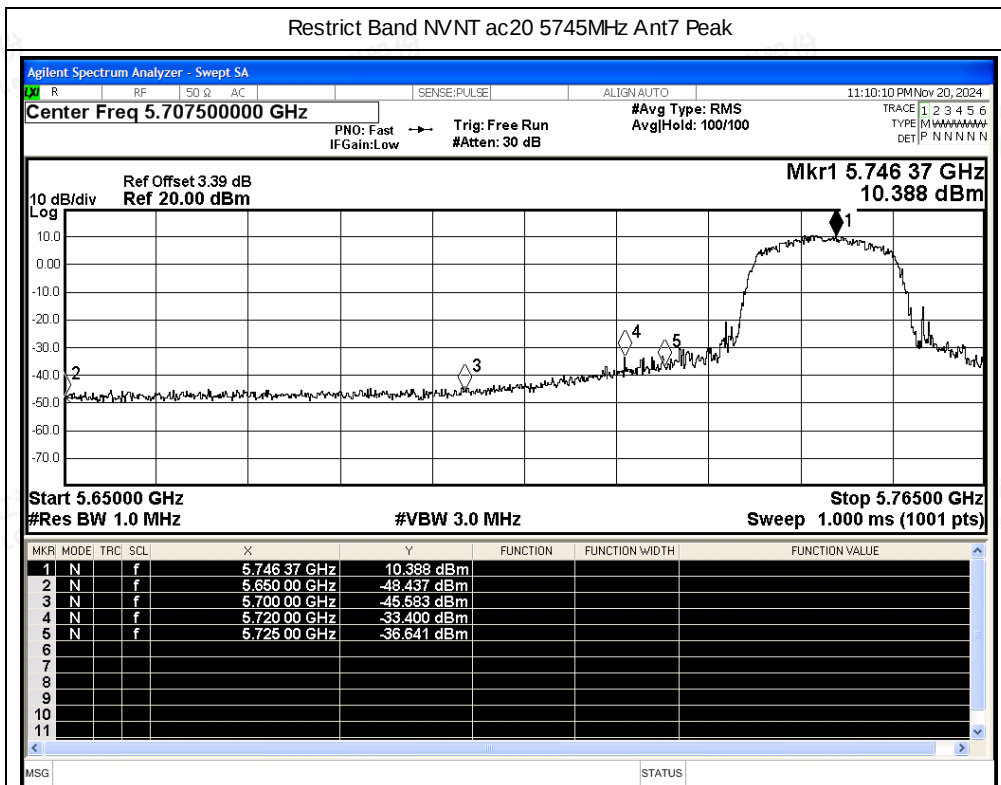


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

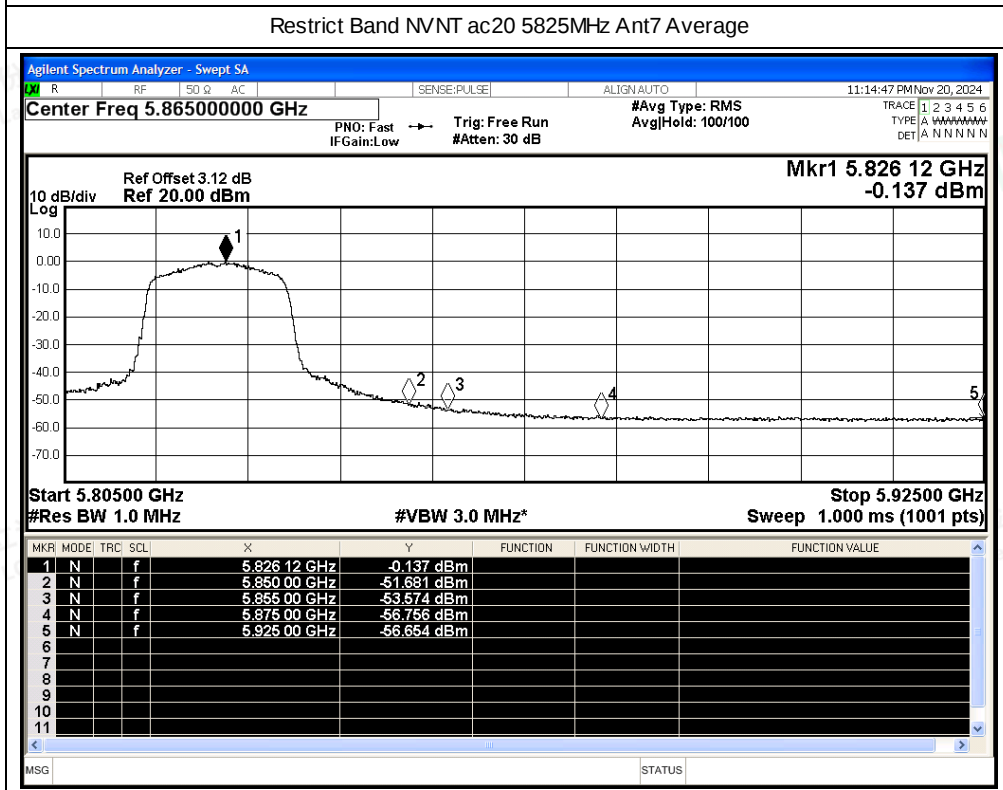
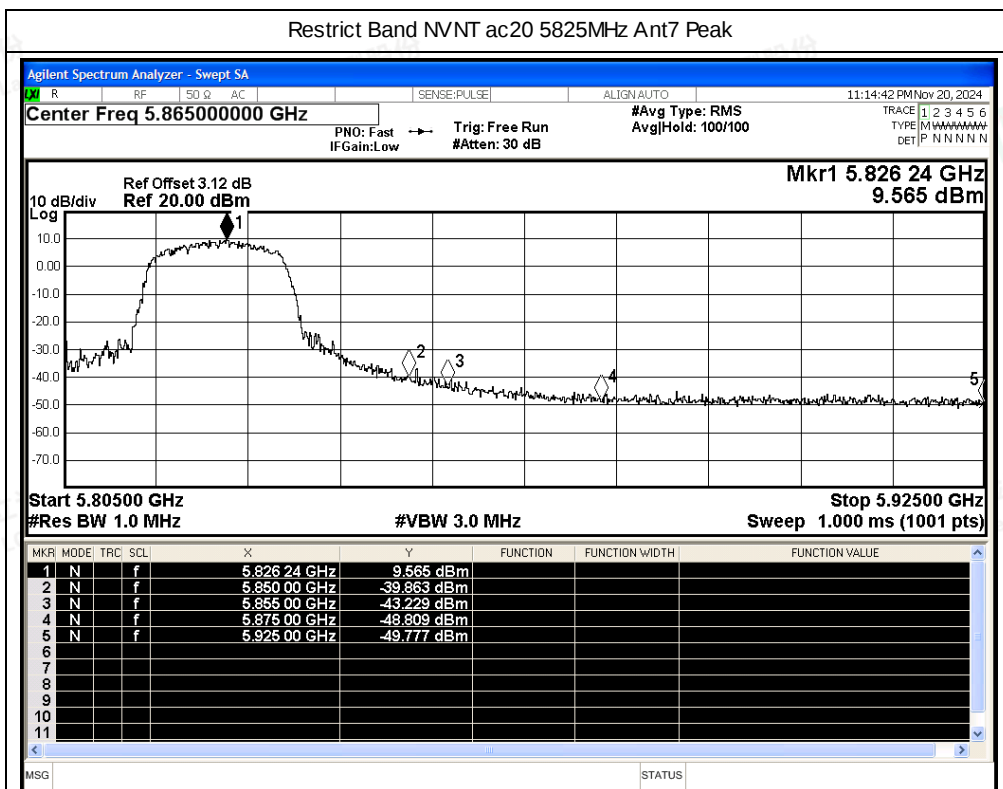


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

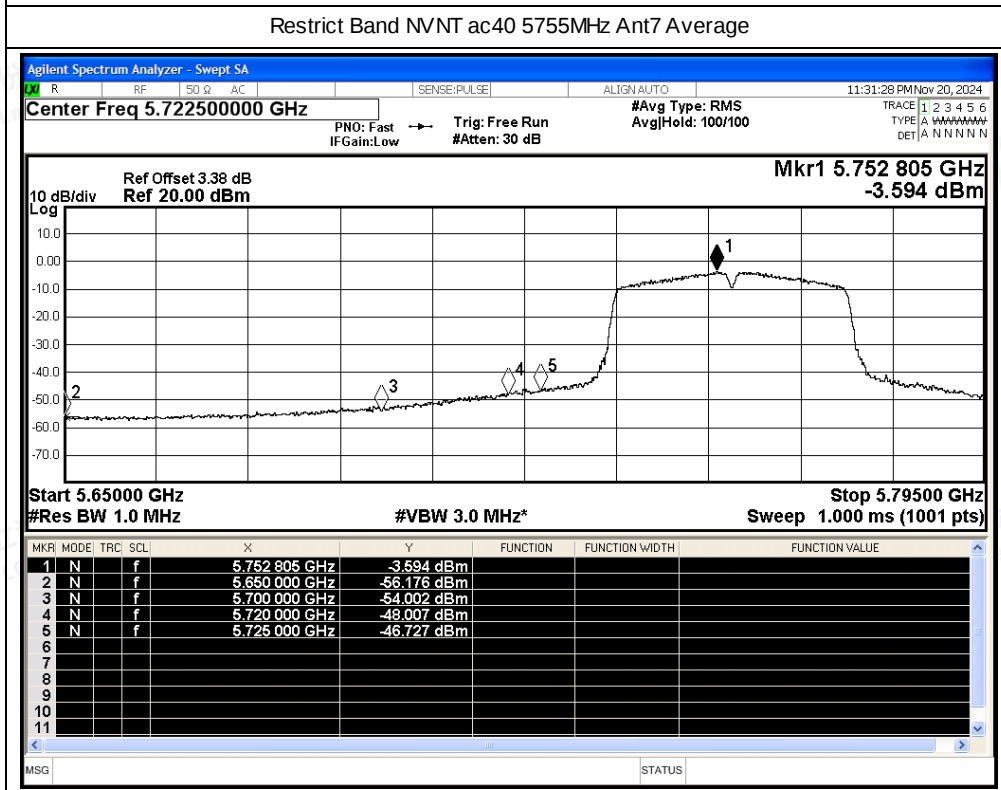
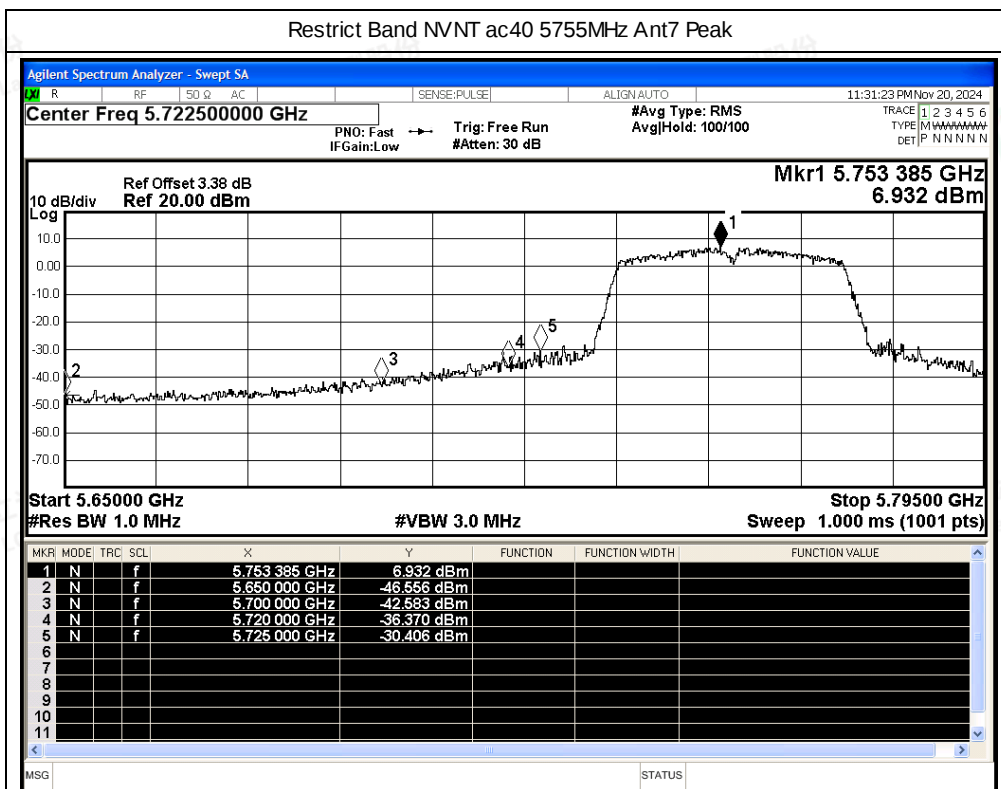


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

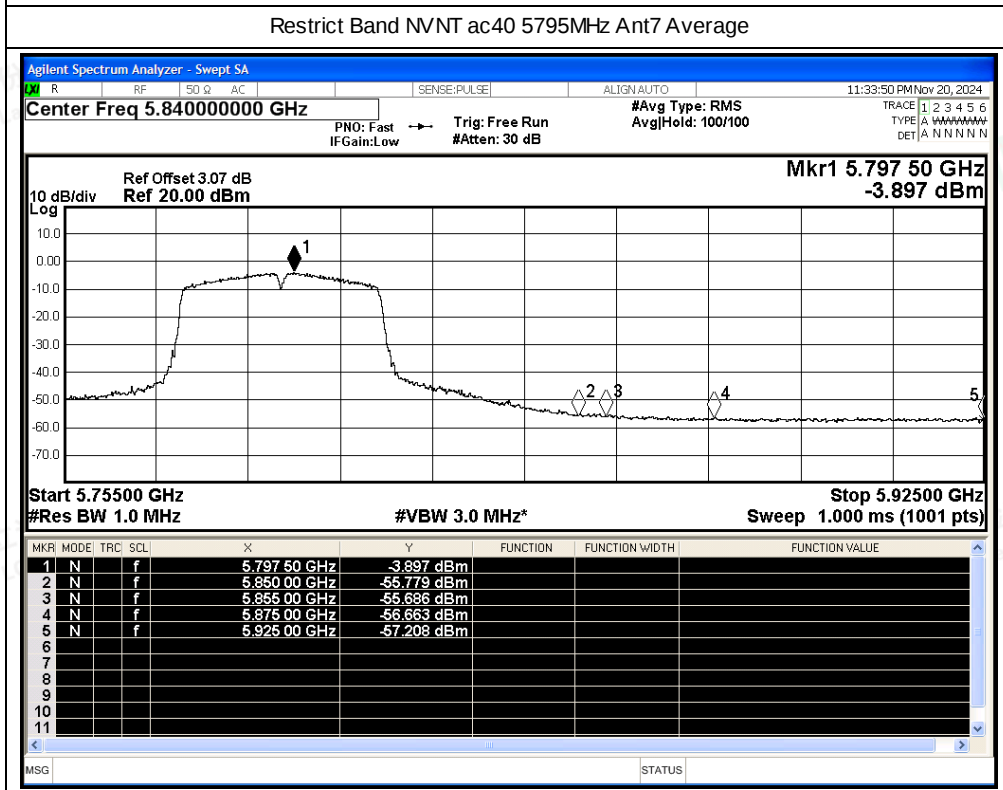
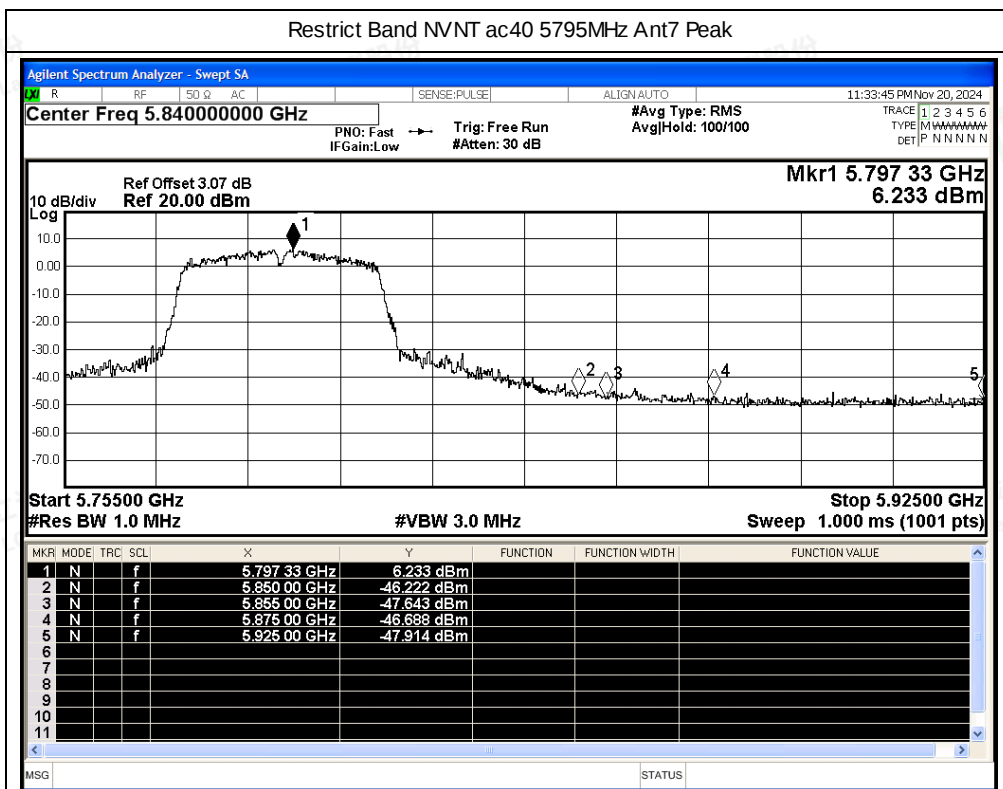


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

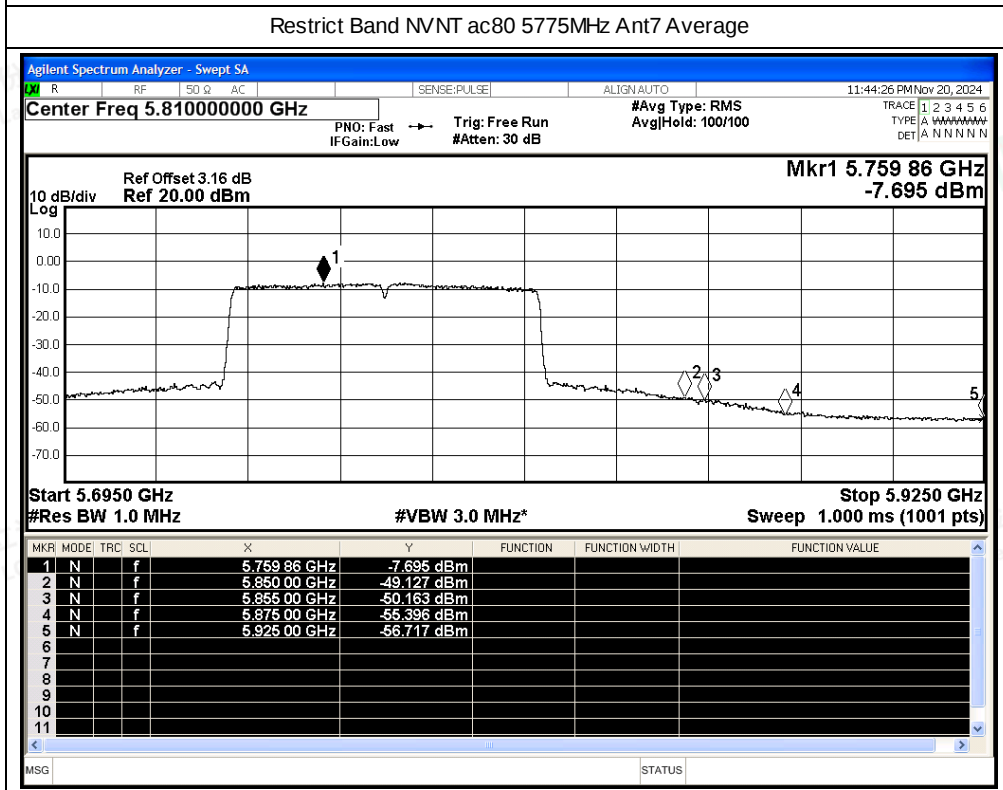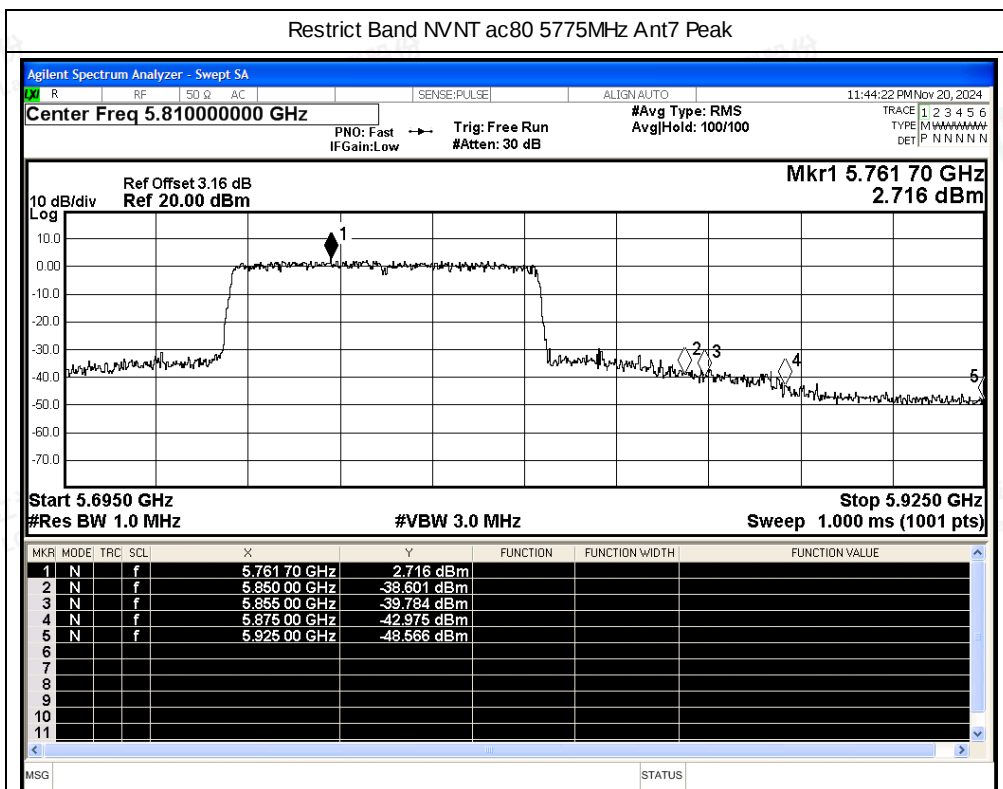

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5775MHz Ant7 Peak

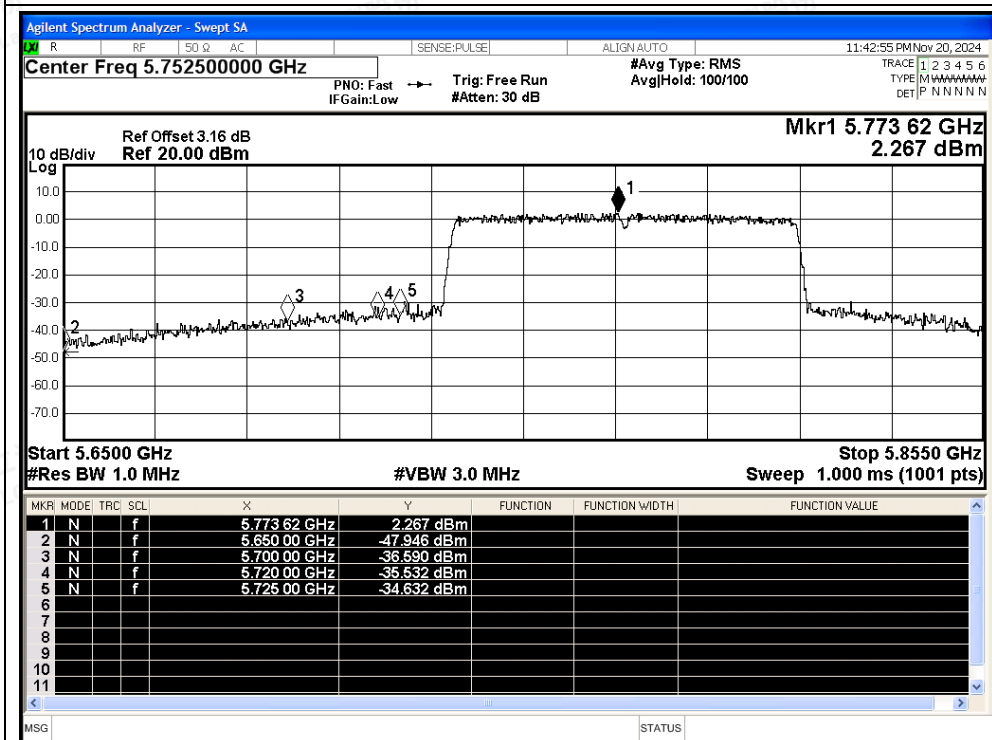

## Restrict Band NVNT ac80 5775MHz Ant7 Average


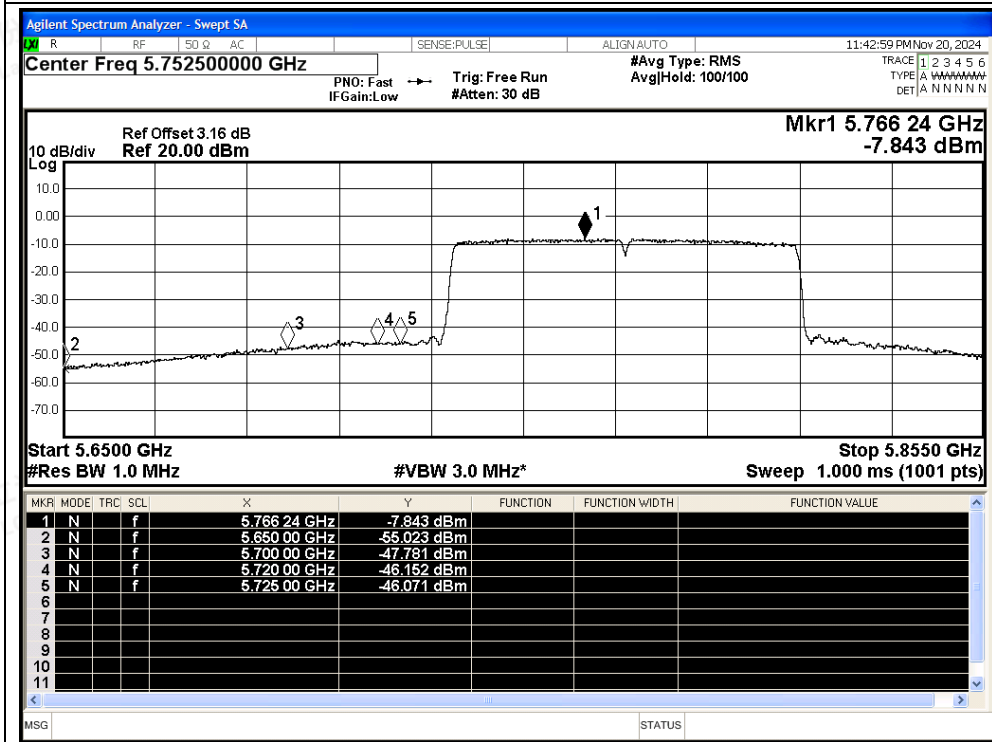


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

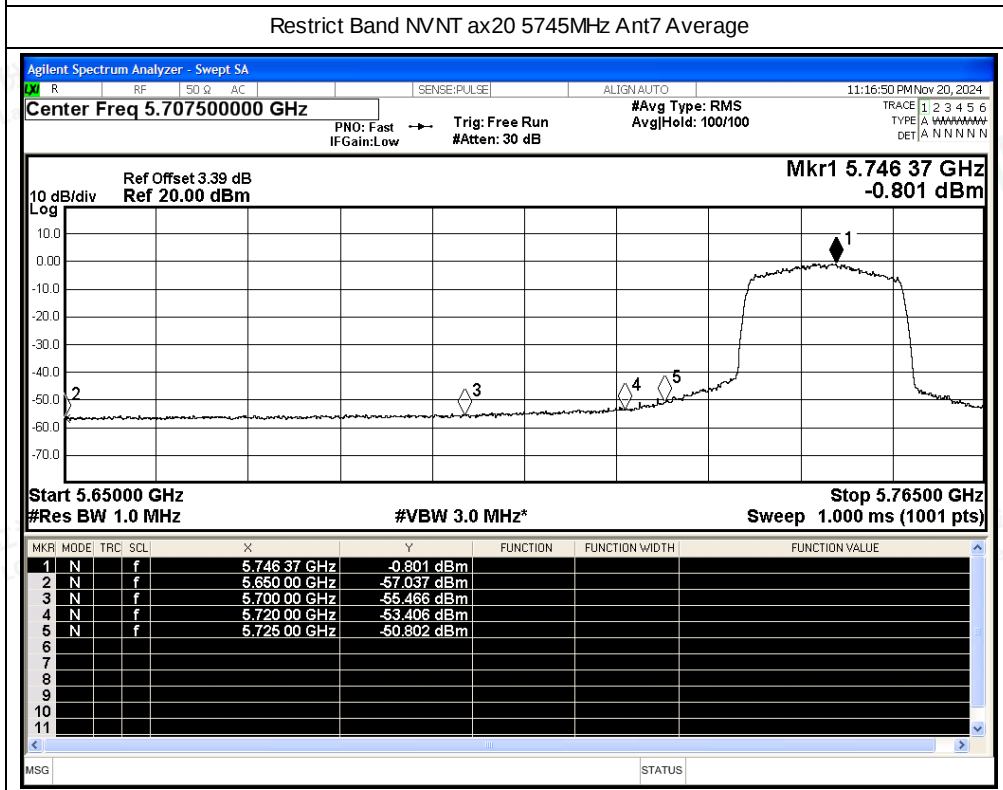
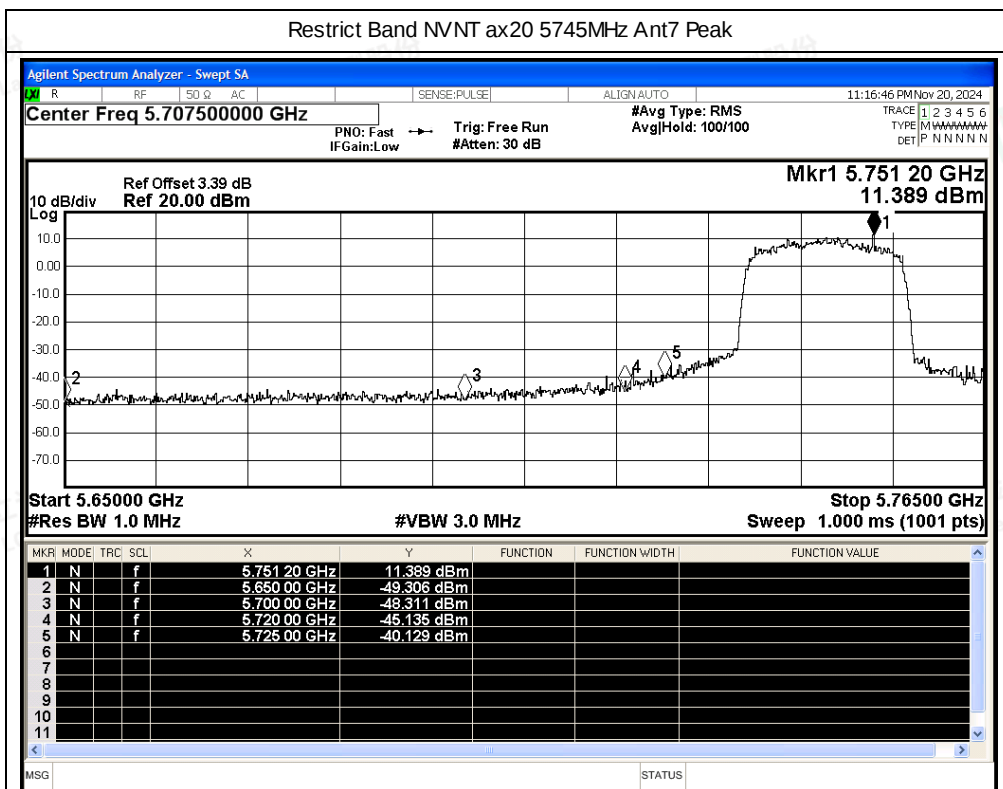


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

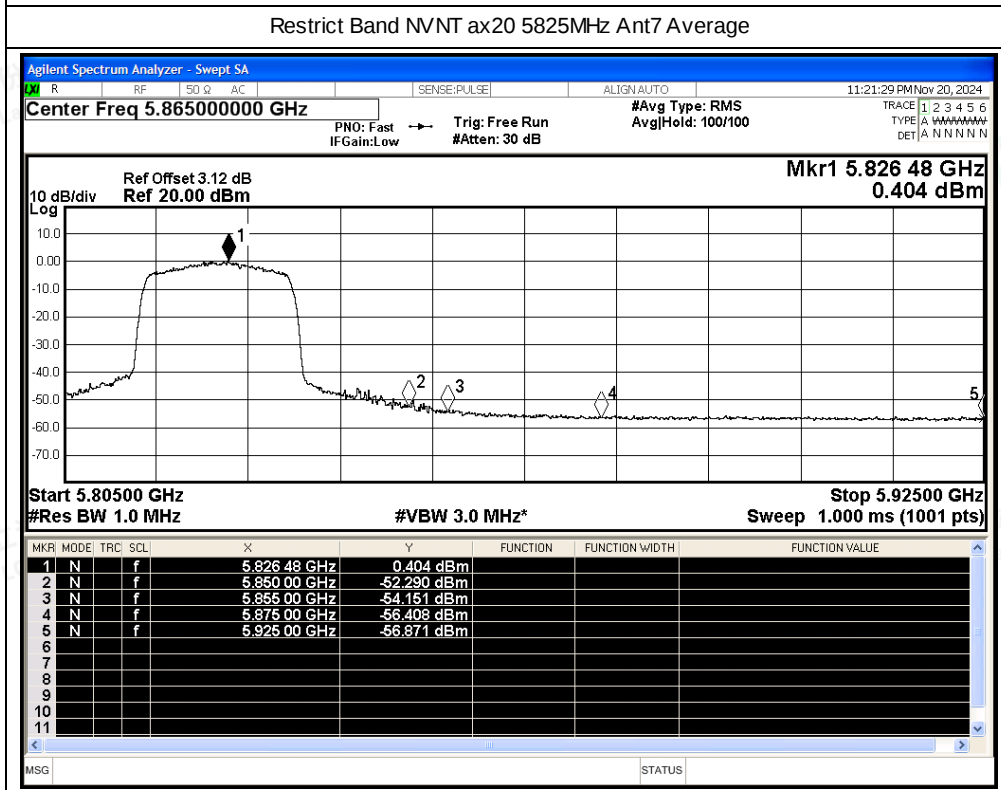
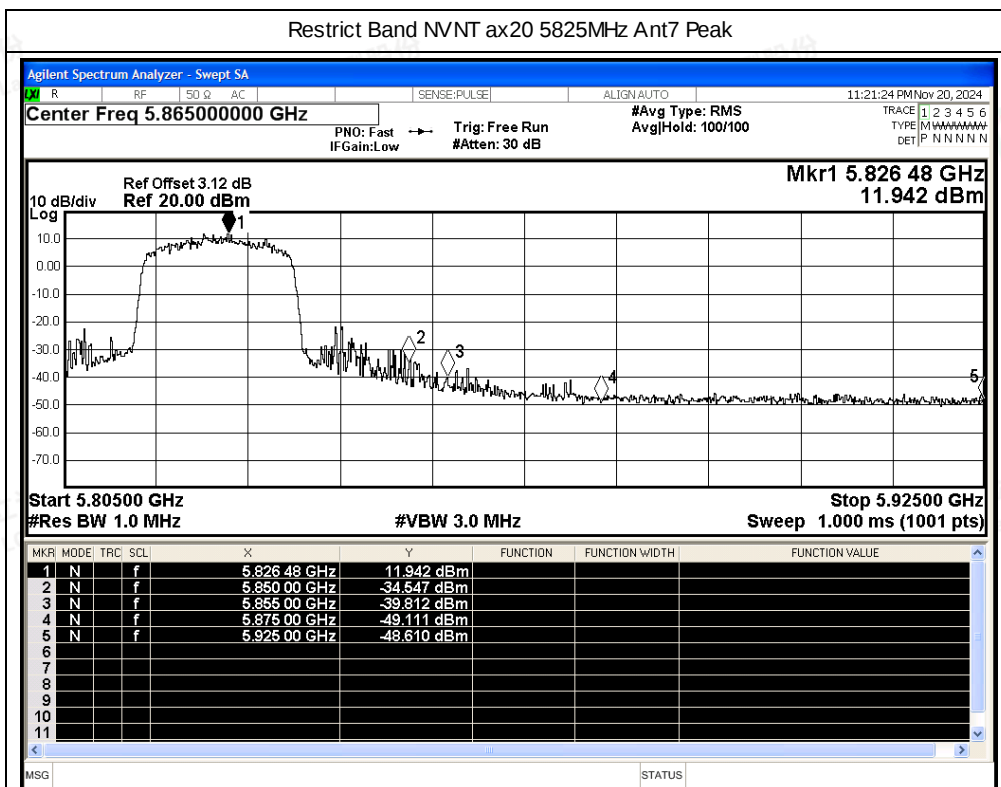


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

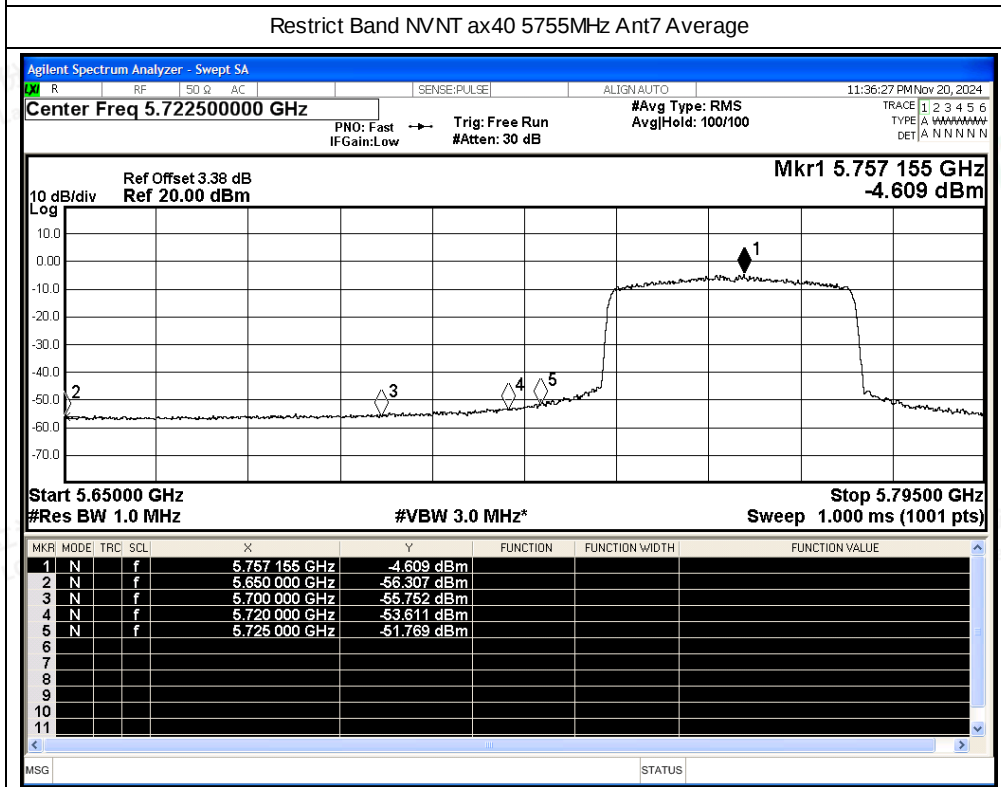
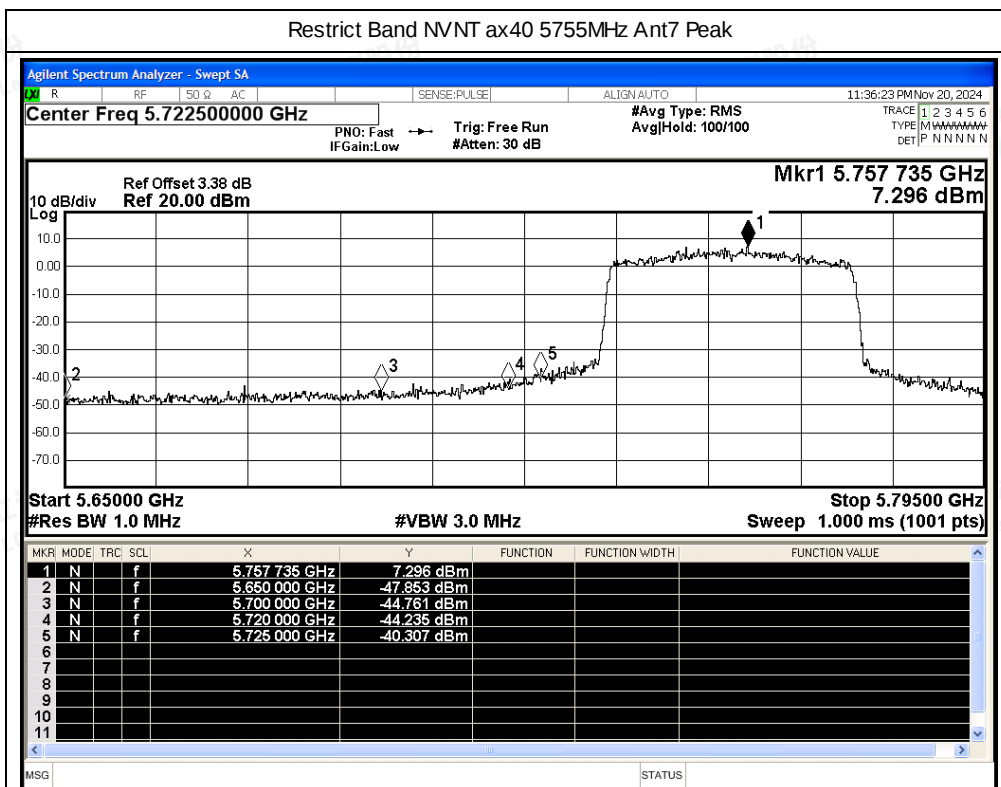


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

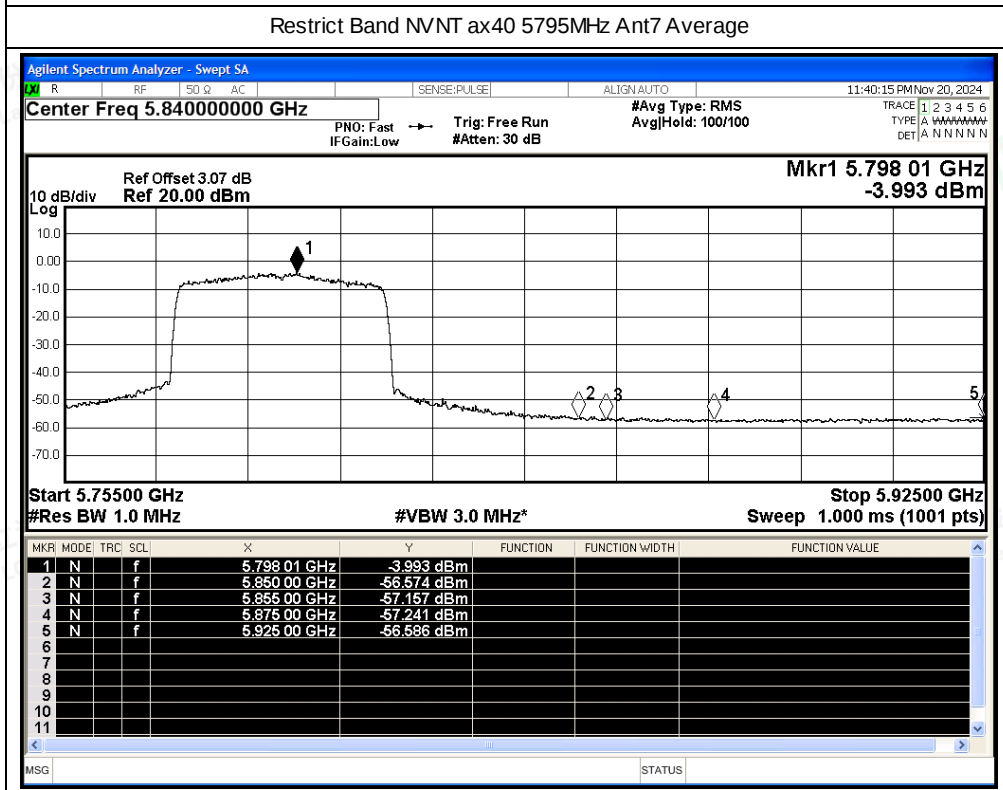
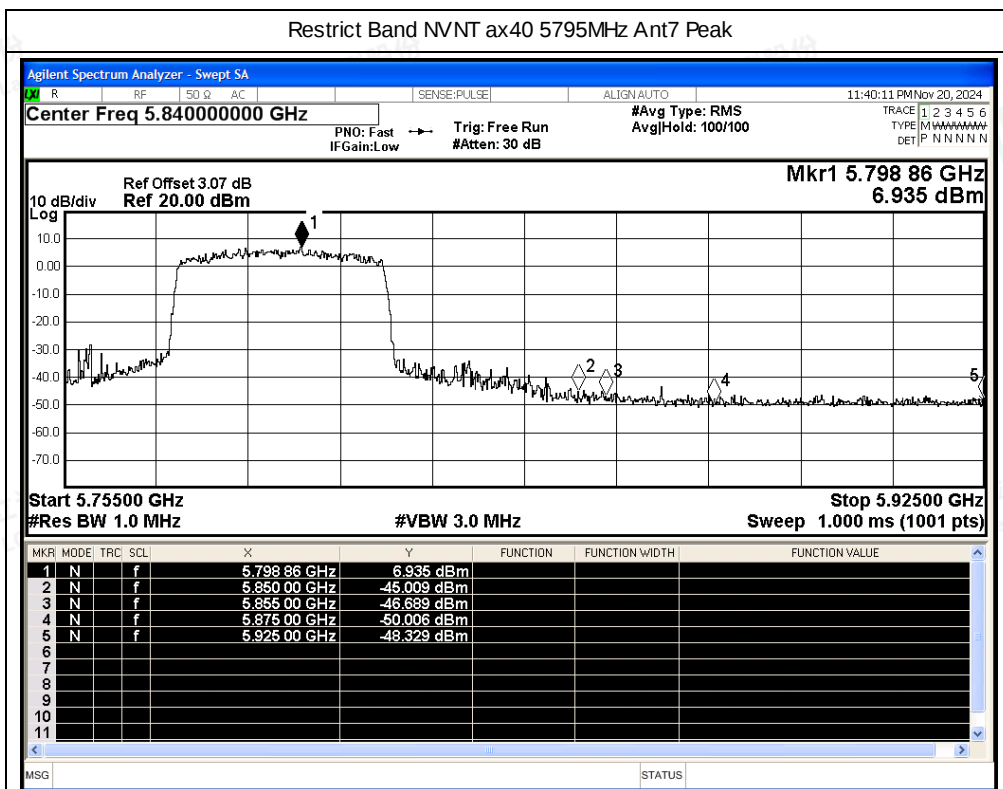


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

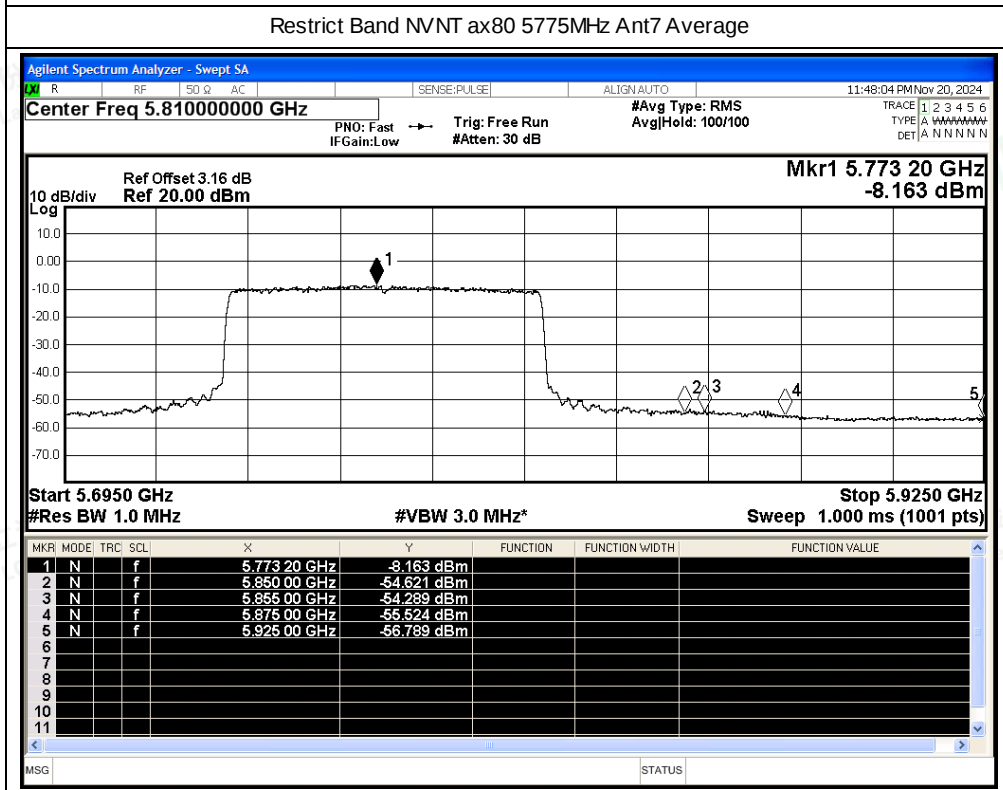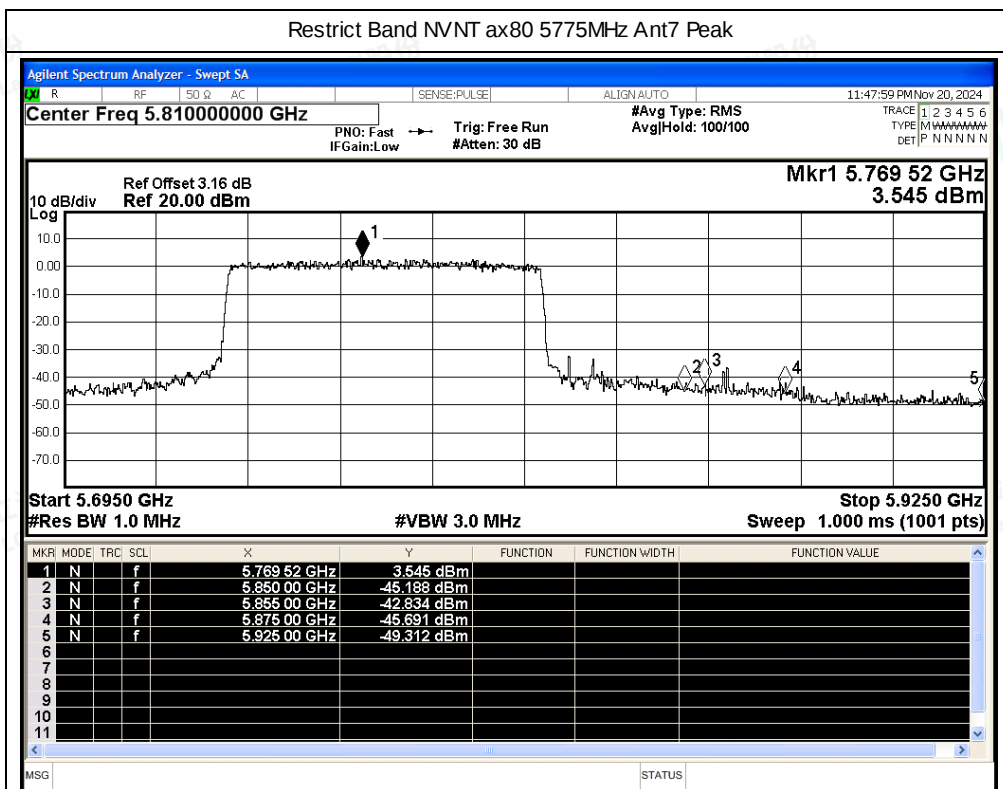

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5775MHz Ant7 Peak

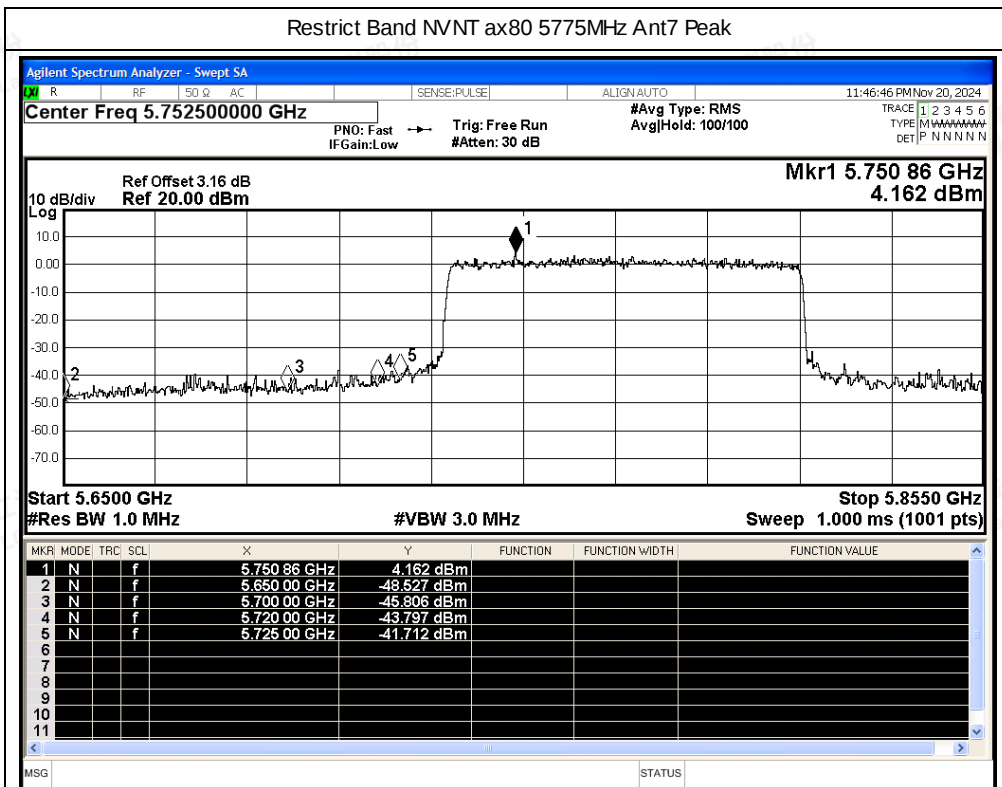

## Restrict Band NVNT ax80 5775MHz Ant7 Average

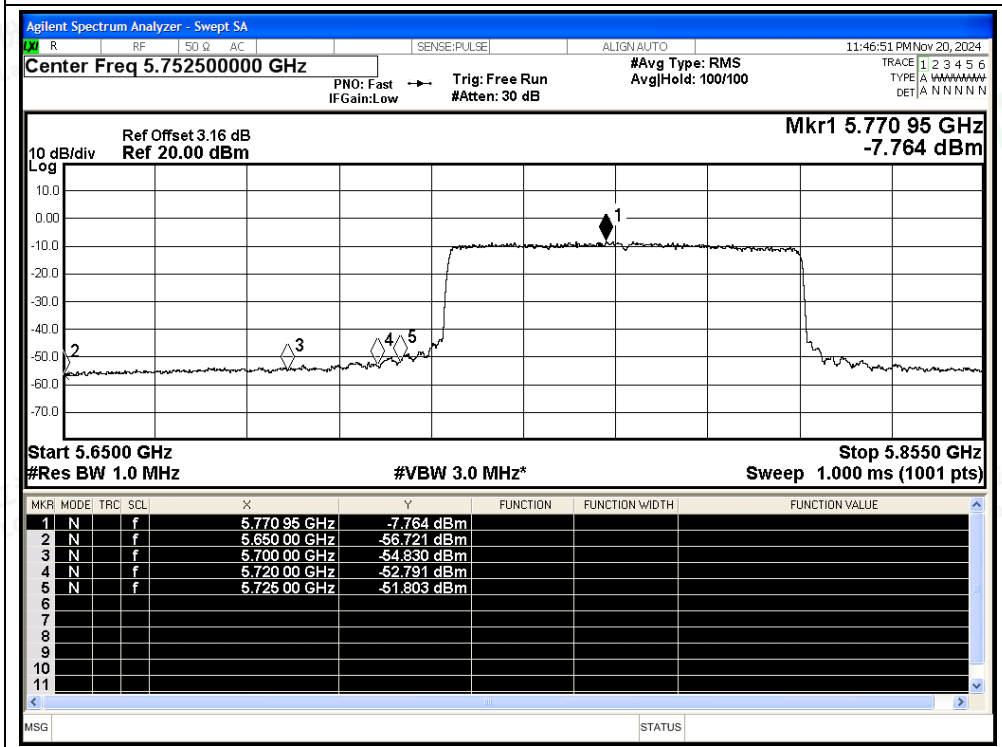

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

| Condition | Mode | Frequency<br>(MHz) | Spur<br>Freq<br>(MHz) | ANT6<br>Power<br>(dBm) | ANT7<br>Power<br>(dBm) | Gain<br>(dBi) | ERP<br>Power<br>(dBm) | Detector | Limit<br>(dBm) | Verdict |
|-----------|------|--------------------|-----------------------|------------------------|------------------------|---------------|-----------------------|----------|----------------|---------|
| NVNT      | n20  | 5745               | 5650                  | -48.44                 | -47.86                 | 2.0           | -43.13                | Peak     | -27            | Pass    |
| NVNT      | n20  | 5745               | 5650                  | -56.68                 | -56.39                 | 2.0           | -51.52                | Average  | -27            | Pass    |
| NVNT      | n20  | 5745               | 5700                  | -45.5                  | -47.45                 | 2.0           | -41.36                | Peak     | 10             | Pass    |
| NVNT      | n20  | 5745               | 5700                  | -54.87                 | -54.88                 | 2.0           | -49.86                | Average  | 10             | Pass    |
| NVNT      | n20  | 5745               | 5720                  | -37.64                 | -35.96                 | 2.0           | -31.71                | Peak     | 15.6           | Pass    |
| NVNT      | n20  | 5745               | 5720                  | -48.18                 | -49.3                  | 2.0           | -43.69                | Average  | 15.6           | Pass    |
| NVNT      | n20  | 5745               | 5725                  | -23.62                 | -35.77                 | 2.0           | -21.36                | Peak     | 27             | Pass    |
| NVNT      | n20  | 5745               | 5725                  | -46.81                 | -47.61                 | 2.0           | -42.18                | Average  | 27             | Pass    |
| NVNT      | n20  | 5825               | 5850                  | -39.74                 | -42.13                 | 2.0           | -35.76                | Peak     | 27             | Pass    |
| NVNT      | n20  | 5825               | 5850                  | -49.73                 | -50.96                 | 2.0           | -45.29                | Average  | 27             | Pass    |
| NVNT      | n20  | 5825               | 5855                  | -38.94                 | -43.16                 | 2.0           | -35.55                | Peak     | 15.6           | Pass    |
| NVNT      | n20  | 5825               | 5855                  | -51.97                 | -52.25                 | 2.0           | -47.10                | Average  | 15.6           | Pass    |
| NVNT      | n20  | 5825               | 5875                  | -45.86                 | -48.41                 | 2.0           | -41.94                | Peak     | 10             | Pass    |
| NVNT      | n20  | 5825               | 5875                  | -55.73                 | -56.89                 | 2.0           | -51.26                | Average  | 10             | Pass    |
| NVNT      | n20  | 5825               | 5925                  | -48.93                 | -49.7                  | 2.0           | -44.29                | Peak     | -27            | Pass    |
| NVNT      | n20  | 5825               | 5925                  | -56.78                 | -56.68                 | 2.0           | -51.72                | Average  | -27            | Pass    |
| NVNT      | n40  | 5755               | 5650                  | -46.61                 | -47.87                 | 2.0           | -42.18                | Peak     | -27            | Pass    |
| NVNT      | n40  | 5755               | 5650                  | -55.86                 | -57.08                 | 2.0           | -51.42                | Average  | -27            | Pass    |
| NVNT      | n40  | 5755               | 5700                  | -41.2                  | -43.24                 | 2.0           | -37.09                | Peak     | 10             | Pass    |
| NVNT      | n40  | 5755               | 5700                  | -51.66                 | -52.67                 | 2.0           | -47.13                | Average  | 10             | Pass    |
| NVNT      | n40  | 5755               | 5720                  | -37.38                 | -38.72                 | 2.0           | -32.99                | Peak     | 15.6           | Pass    |
| NVNT      | n40  | 5755               | 5720                  | -45.51                 | -47.07                 | 2.0           | -41.21                | Average  | 15.6           | Pass    |
| NVNT      | n40  | 5755               | 5725                  | -36.02                 | -33.7                  | 2.0           | -29.70                | Peak     | 27             | Pass    |
| NVNT      | n40  | 5755               | 5725                  | -45.39                 | -45.82                 | 2.0           | -40.59                | Average  | 27             | Pass    |
| NVNT      | n40  | 5795               | 5850                  | -44.94                 | -46.05                 | 2.0           | -40.45                | Peak     | 27             | Pass    |
| NVNT      | n40  | 5795               | 5850                  | -54.5                  | -55.08                 | 2.0           | -49.77                | Average  | 27             | Pass    |
| NVNT      | n40  | 5795               | 5855                  | -47.01                 | -47.28                 | 2.0           | -42.13                | Peak     | 15.6           | Pass    |
| NVNT      | n40  | 5795               | 5855                  | -55.4                  | -55.36                 | 2.0           | -50.37                | Average  | 15.6           | Pass    |
| NVNT      | n40  | 5795               | 5875                  | -48.5                  | -48.25                 | 2.0           | -43.36                | Peak     | 10             | Pass    |
| NVNT      | n40  | 5795               | 5875                  | -57.3                  | -56.62                 | 2.0           | -51.94                | Average  | 10             | Pass    |
| NVNT      | n40  | 5795               | 5925                  | -48.21                 | -49.76                 | 2.0           | -43.91                | Peak     | -27            | Pass    |
| NVNT      | n40  | 5795               | 5925                  | -57.31                 | -57.02                 | 2.0           | -52.15                | Average  | -27            | Pass    |
| NVNT      | ac20 | 5745               | 5650                  | -48.68                 | -48.44                 | 2.0           | -43.55                | Peak     | -27            | Pass    |
| NVNT      | ac20 | 5745               | 5650                  | -56.61                 | -56.23                 | 2.0           | -51.41                | Average  | -27            | Pass    |
| NVNT      | ac20 | 5745               | 5700                  | -45.49                 | -45.58                 | 2.0           | -40.52                | Peak     | 10             | Pass    |
| NVNT      | ac20 | 5745               | 5700                  | -55.59                 | -55.13                 | 2.0           | -50.34                | Average  | 10             | Pass    |
| NVNT      | ac20 | 5745               | 5720                  | -35.28                 | -33.4                  | 2.0           | -29.23                | Peak     | 15.6           | Pass    |
| NVNT      | ac20 | 5745               | 5720                  | -48.36                 | -48.96                 | 2.0           | -43.64                | Average  | 15.6           | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |        |        |     |        |         |      |      |
|------|------|------|------|--------|--------|-----|--------|---------|------|------|
| NVNT | ac20 | 5745 | 5725 | -35.71 | -36.64 | 2.0 | -31.14 | Peak    | 27   | Pass |
| NVNT | ac20 | 5745 | 5725 | -46.43 | -47.13 | 2.0 | -41.76 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | 5850 | -39.24 | -39.86 | 2.0 | -34.53 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | 5850 | -49.65 | -51.68 | 2.0 | -45.54 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | 5855 | -39.46 | -43.23 | 2.0 | -35.94 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | 5855 | -51.66 | -53.57 | 2.0 | -47.50 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | 5875 | -47.27 | -48.81 | 2.0 | -42.96 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | 5875 | -55.52 | -56.76 | 2.0 | -51.09 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | 5925 | -48.43 | -49.78 | 2.0 | -44.04 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | 5925 | -56.6  | -56.65 | 2.0 | -51.61 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | 5650 | -47.45 | -46.56 | 2.0 | -41.97 | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | 5650 | -56.99 | -56.18 | 2.0 | -51.56 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | 5700 | -42.16 | -42.58 | 2.0 | -37.35 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | 5700 | -51.8  | -54    | 2.0 | -47.75 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | 5720 | -33.55 | -36.37 | 2.0 | -29.72 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | 5720 | -45.67 | -48.01 | 2.0 | -41.67 | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | 5725 | -34.23 | -30.41 | 2.0 | -26.90 | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | 5725 | -45.27 | -46.73 | 2.0 | -40.93 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | 5850 | -44.25 | -46.22 | 2.0 | -40.11 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | 5850 | -55.22 | -55.78 | 2.0 | -50.48 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | 5855 | -45.44 | -47.64 | 2.0 | -41.39 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5795 | 5855 | -55.29 | -55.69 | 2.0 | -50.48 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | 5875 | -47    | -46.69 | 2.0 | -41.83 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | 5875 | -56.53 | -56.66 | 2.0 | -51.58 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | 5925 | -49.97 | -47.91 | 2.0 | -43.81 | Peak    | -27  | Pass |
| NVNT | ac40 | 5795 | 5925 | -57.23 | -57.21 | 2.0 | -52.21 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | 5850 | -36.61 | -38.6  | 2.0 | -32.48 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | 5850 | -48.1  | -49.13 | 2.0 | -43.57 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | 5855 | -36.14 | -39.78 | 2.0 | -32.58 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5855 | -49.54 | -50.16 | 2.0 | -44.83 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5875 | -41.77 | -42.98 | 2.0 | -37.32 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | 5875 | -54.2  | -55.4  | 2.0 | -49.75 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | 5925 | -47.94 | -48.57 | 2.0 | -43.23 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | 5925 | -57.28 | -56.72 | 2.0 | -51.98 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | 5650 | -44.36 | -47.95 | 2.0 | -40.78 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | 5650 | -54.4  | -55.02 | 2.0 | -49.69 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | 5700 | -37    | -36.59 | 2.0 | -31.78 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | 5700 | -47.19 | -47.78 | 2.0 | -42.46 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | 5720 | -32.05 | -35.53 | 2.0 | -28.44 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5720 | -45.93 | -46.15 | 2.0 | -41.03 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5725 | -35.31 | -34.63 | 2.0 | -29.95 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | 5725 | -44.14 | -46.07 | 2.0 | -39.99 | Average | 27   | Pass |
| NVNT | ax20 | 5745 | 5650 | -49.76 | -49.31 | 2.0 | -44.52 | Peak    | -27  | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |        |        |     |        |         |      |      |
|------|------|------|------|--------|--------|-----|--------|---------|------|------|
| NVNT | ax20 | 5745 | 5650 | -56.71 | -57.04 | 2.0 | -51.86 | Average | -27  | Pass |
| NVNT | ax20 | 5745 | 5700 | -46.27 | -48.31 | 2.0 | -42.16 | Peak    | 10   | Pass |
| NVNT | ax20 | 5745 | 5700 | -55.92 | -55.47 | 2.0 | -50.68 | Average | 10   | Pass |
| NVNT | ax20 | 5745 | 5720 | -40.72 | -45.14 | 2.0 | -37.38 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5745 | 5720 | -53.22 | -53.41 | 2.0 | -48.30 | Average | 15.6 | Pass |
| NVNT | ax20 | 5745 | 5725 | -36.46 | -40.13 | 2.0 | -32.91 | Peak    | 27   | Pass |
| NVNT | ax20 | 5745 | 5725 | -50.07 | -50.8  | 2.0 | -45.41 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | 5850 | -39.87 | -34.55 | 2.0 | -31.43 | Peak    | 27   | Pass |
| NVNT | ax20 | 5825 | 5850 | -53.25 | -52.29 | 2.0 | -47.73 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | 5855 | -36.6  | -39.81 | 2.0 | -32.90 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5825 | 5855 | -54.55 | -54.15 | 2.0 | -49.34 | Average | 15.6 | Pass |
| NVNT | ax20 | 5825 | 5875 | -46.65 | -49.11 | 2.0 | -42.70 | Peak    | 10   | Pass |
| NVNT | ax20 | 5825 | 5875 | -56.2  | -56.41 | 2.0 | -51.29 | Average | 10   | Pass |
| NVNT | ax20 | 5825 | 5925 | -49.03 | -48.61 | 2.0 | -43.80 | Peak    | -27  | Pass |
| NVNT | ax20 | 5825 | 5925 | -57.25 | -56.87 | 2.0 | -52.05 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | 5650 | -47.86 | -47.85 | 2.0 | -42.84 | Peak    | -27  | Pass |
| NVNT | ax40 | 5755 | 5650 | -57.32 | -56.31 | 2.0 | -51.78 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | 5700 | -44.81 | -44.76 | 2.0 | -39.77 | Peak    | 10   | Pass |
| NVNT | ax40 | 5755 | 5700 | -53.93 | -55.75 | 2.0 | -49.74 | Average | 10   | Pass |
| NVNT | ax40 | 5755 | 5720 | -38.01 | -44.24 | 2.0 | -35.08 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5755 | 5720 | -50.74 | -53.61 | 2.0 | -46.93 | Average | 15.6 | Pass |
| NVNT | ax40 | 5755 | 5725 | -33.42 | -40.31 | 2.0 | -30.61 | Peak    | 27   | Pass |
| NVNT | ax40 | 5755 | 5725 | -46.86 | -51.77 | 2.0 | -43.64 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | 5850 | -47.03 | -45.01 | 2.0 | -40.89 | Peak    | 27   | Pass |
| NVNT | ax40 | 5795 | 5850 | -56.53 | -56.57 | 2.0 | -51.54 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | 5855 | -49.02 | -46.69 | 2.0 | -42.69 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5795 | 5855 | -57.12 | -57.16 | 2.0 | -52.13 | Average | 15.6 | Pass |
| NVNT | ax40 | 5795 | 5875 | -48.93 | -50.01 | 2.0 | -44.43 | Peak    | 10   | Pass |
| NVNT | ax40 | 5795 | 5875 | -57.29 | -57.24 | 2.0 | -52.25 | Average | 10   | Pass |
| NVNT | ax40 | 5795 | 5925 | -49.65 | -48.33 | 2.0 | -43.93 | Peak    | -27  | Pass |
| NVNT | ax40 | 5795 | 5925 | -57.41 | -56.59 | 2.0 | -51.97 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | 5850 | -40.06 | -45.19 | 2.0 | -36.90 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | 5850 | -52.28 | -54.62 | 2.0 | -48.28 | Average | 27   | Pass |
| NVNT | ax80 | 5775 | 5855 | -39.53 | -42.83 | 2.0 | -35.86 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5855 | -52.36 | -54.29 | 2.0 | -48.21 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5875 | -44.66 | -45.69 | 2.0 | -40.13 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | 5875 | -54.78 | -55.52 | 2.0 | -50.12 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | 5925 | -48.15 | -49.31 | 2.0 | -43.68 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | 5925 | -56.78 | -56.79 | 2.0 | -51.77 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | 5650 | -45.46 | -48.53 | 2.0 | -41.72 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | 5650 | -55.56 | -56.72 | 2.0 | -51.09 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | 5700 | -36.8  | -45.81 | 2.0 | -34.29 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | 5700 | -53.14 | -54.83 | 2.0 | -48.89 | Average | 10   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |        |        |     |        |         |      |      |
|------|------|------|------|--------|--------|-----|--------|---------|------|------|
| NVNT | ax80 | 5775 | 5720 | -41.13 | -43.8  | 2.0 | -37.25 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5720 | -52.76 | -52.79 | 2.0 | -47.76 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5725 | -39.88 | -41.71 | 2.0 | -35.69 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | 5725 | -50.78 | -51.8  | 2.0 | -46.25 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.  
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China  
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com  
Scan code to check authenticity



## G.5 Frequency Stability


| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5745            | Ant6    | 5745.02                  | 20000                | 3.48            | 25          | Pass    |
| NVNT      | a    | 5785            | Ant6    | 5785.02                  | 20000                | 3.46            | 25          | Pass    |
| NVNT      | a    | 5825            | Ant6    | 5824.98                  | -20000               | -3.43           | 25          | Pass    |
| NVNT      | n20  | 5745            | Ant6    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | n20  | 5785            | Ant6    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | n20  | 5825            | Ant6    | 5825                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40  | 5755            | Ant6    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | n40  | 5795            | Ant6    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ac20 | 5745            | Ant6    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ac20 | 5785            | Ant6    | 5785                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5825            | Ant6    | 5825                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5755            | Ant6    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | ac40 | 5795            | Ant6    | 5795                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac80 | 5775            | Ant6    | 5775                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5745            | Ant6    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ax20 | 5785            | Ant6    | 5785                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5825            | Ant6    | 5825                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40 | 5755            | Ant6    | 5755                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40 | 5795            | Ant6    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ax80 | 5775            | Ant6    | 5775                     | 0                    | 0               | 25          | Pass    |






## Test Graphs

## Freq. Stability NVNT a 5745MHz Ant6

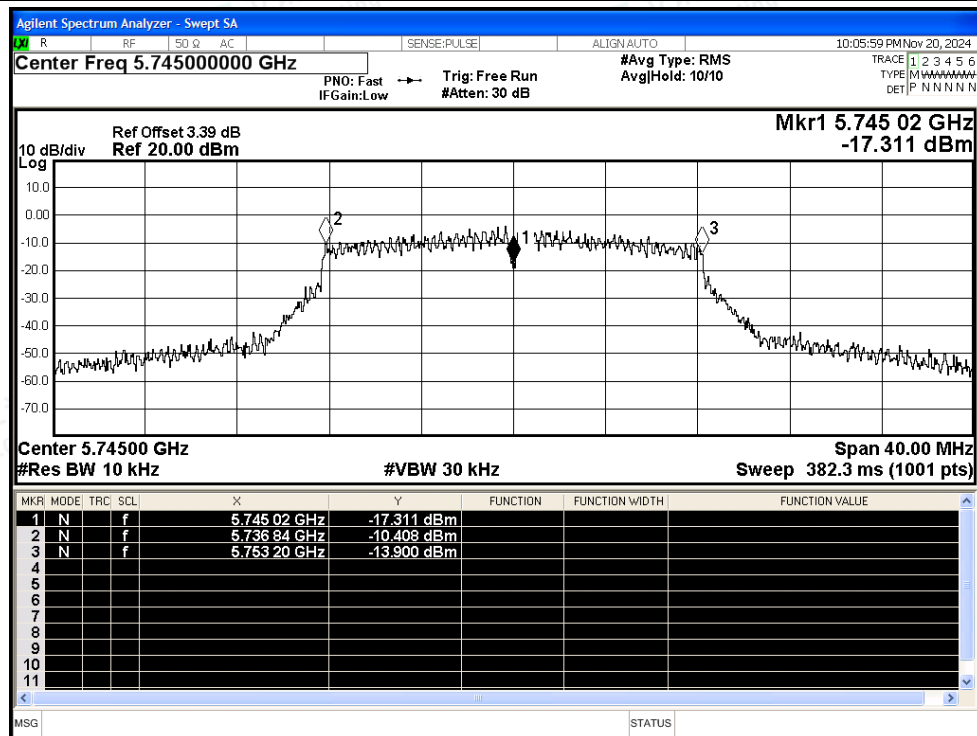

## Freq. Stability NVNT a 5785MHz Ant6


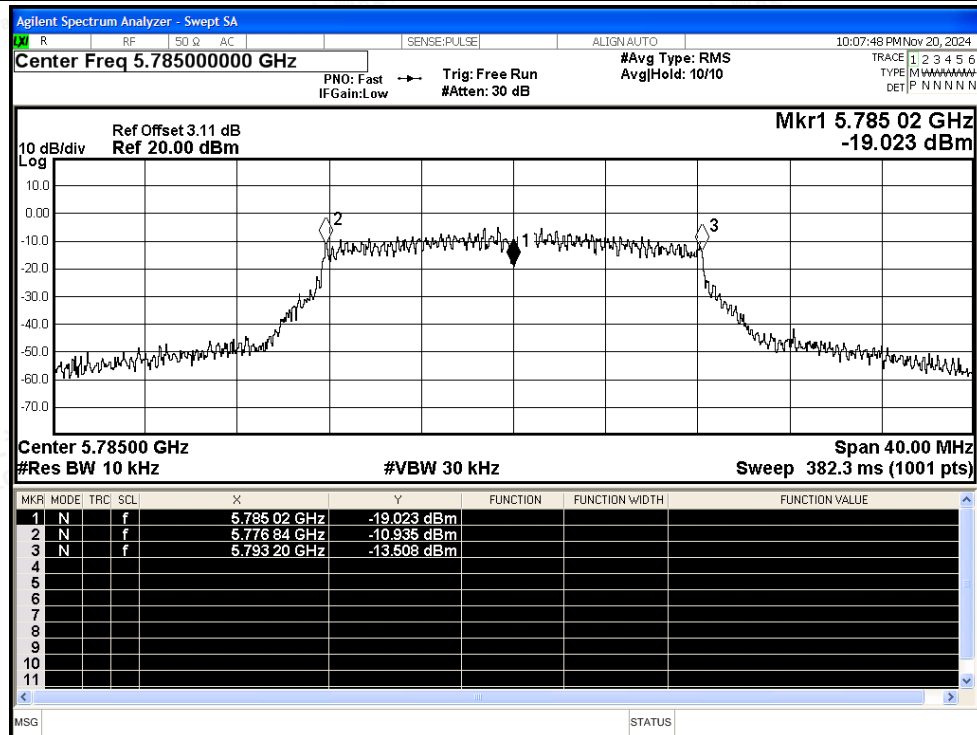


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

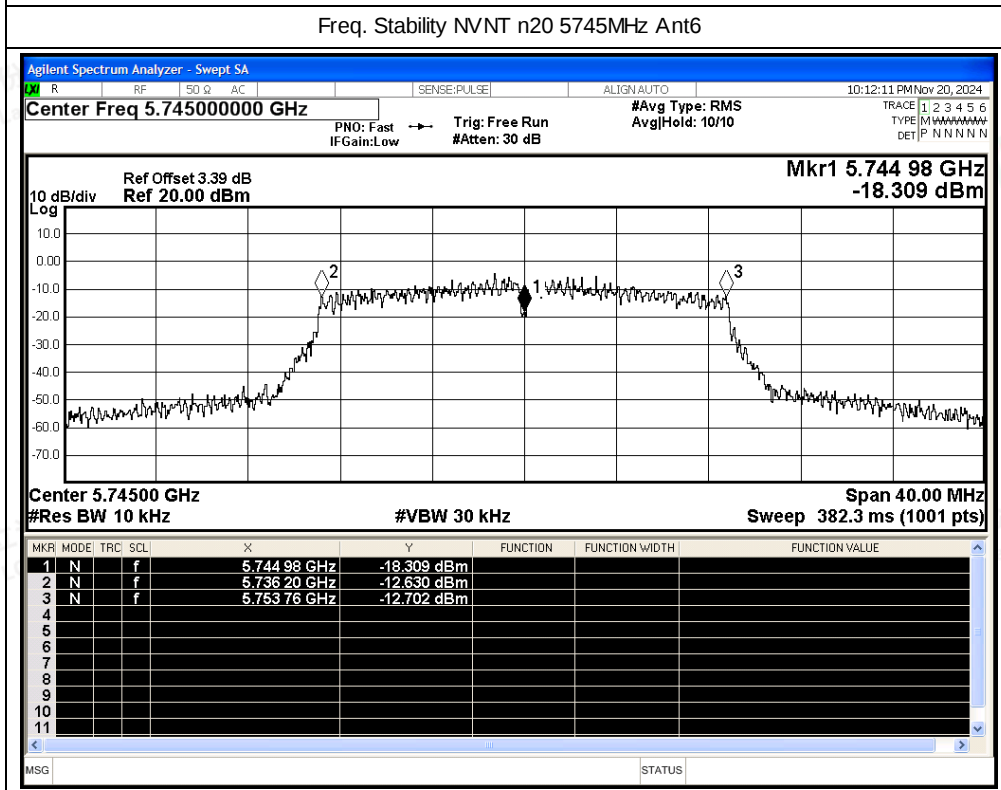
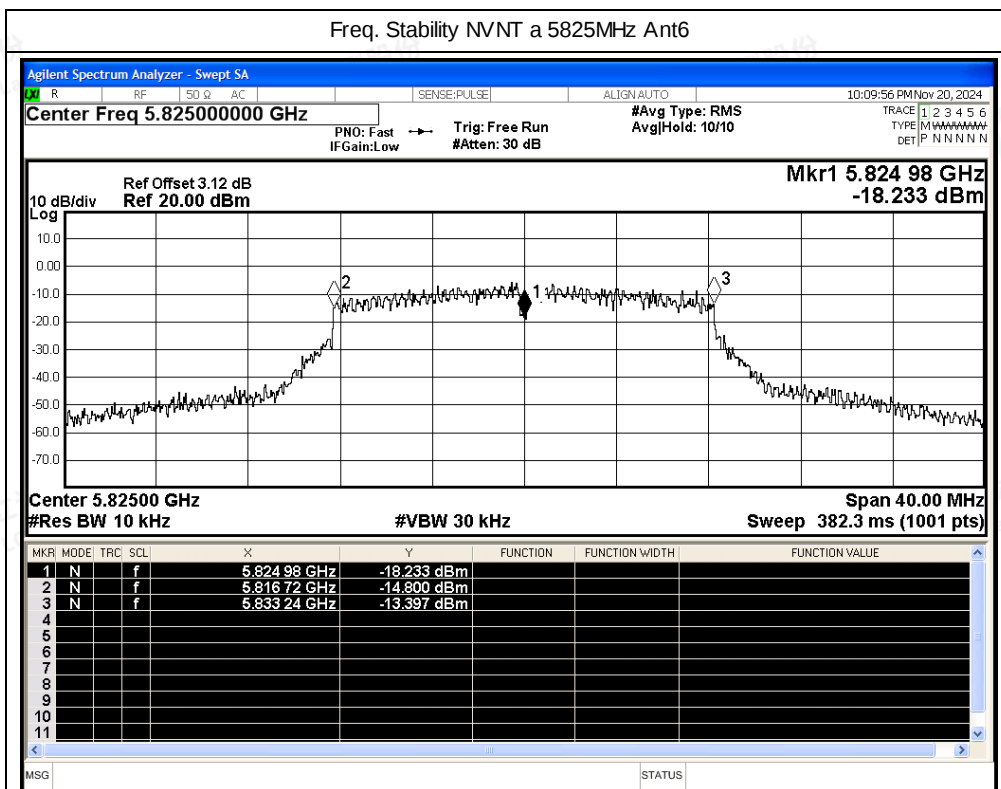


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

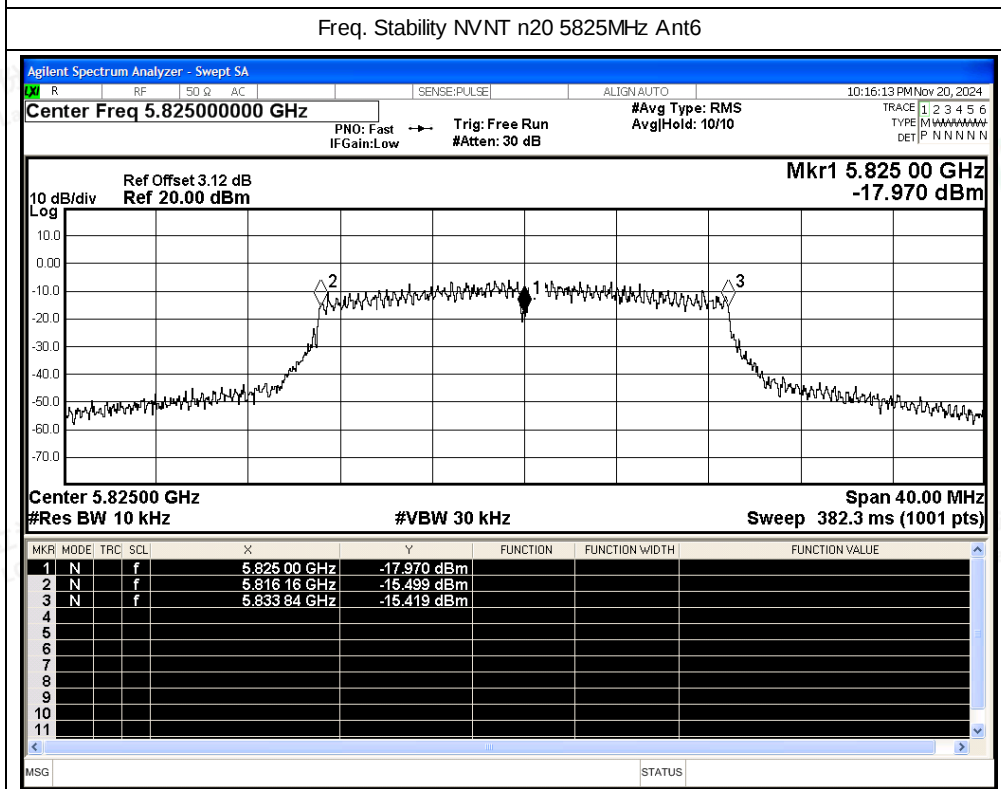
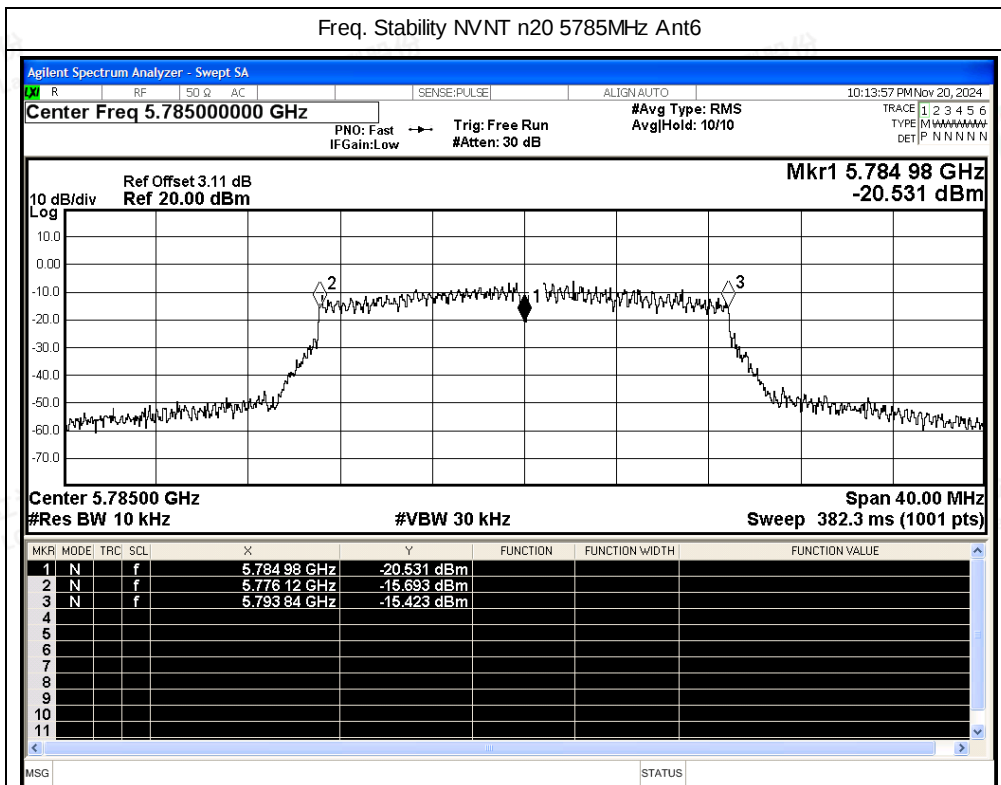


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

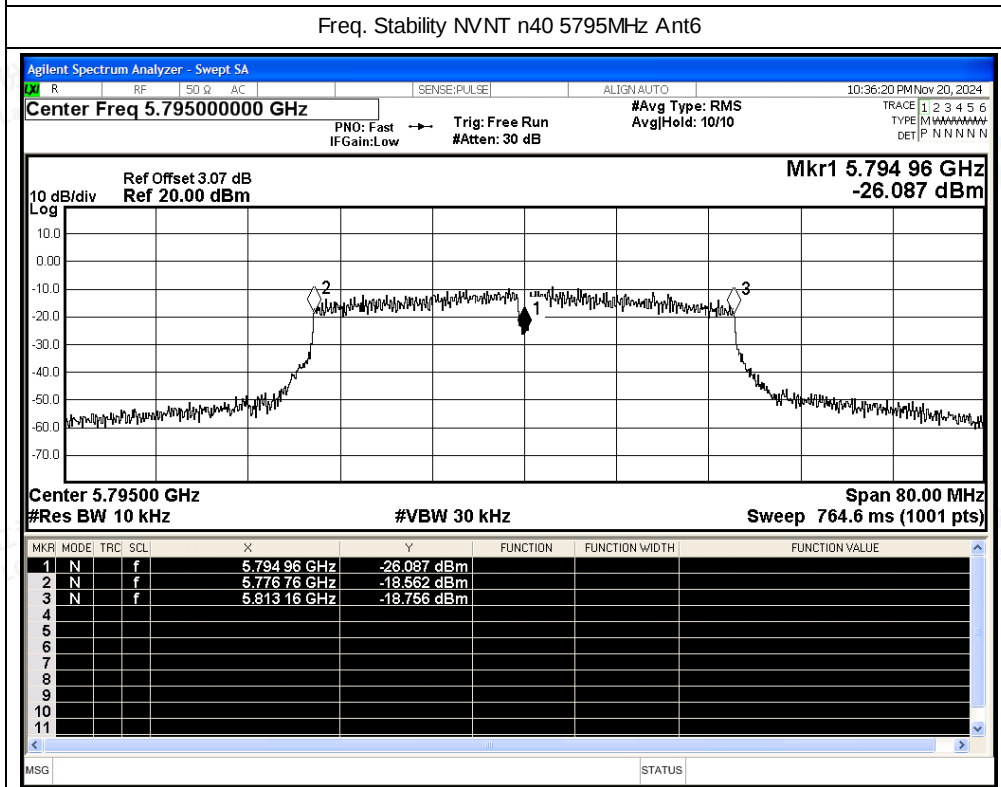
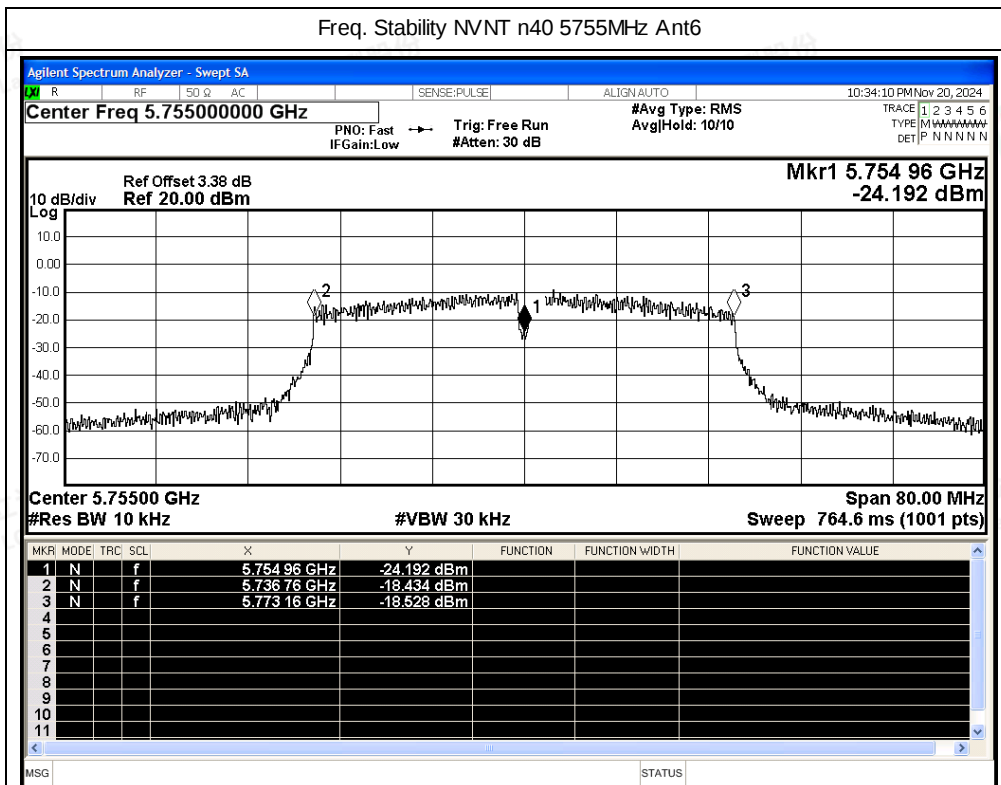


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

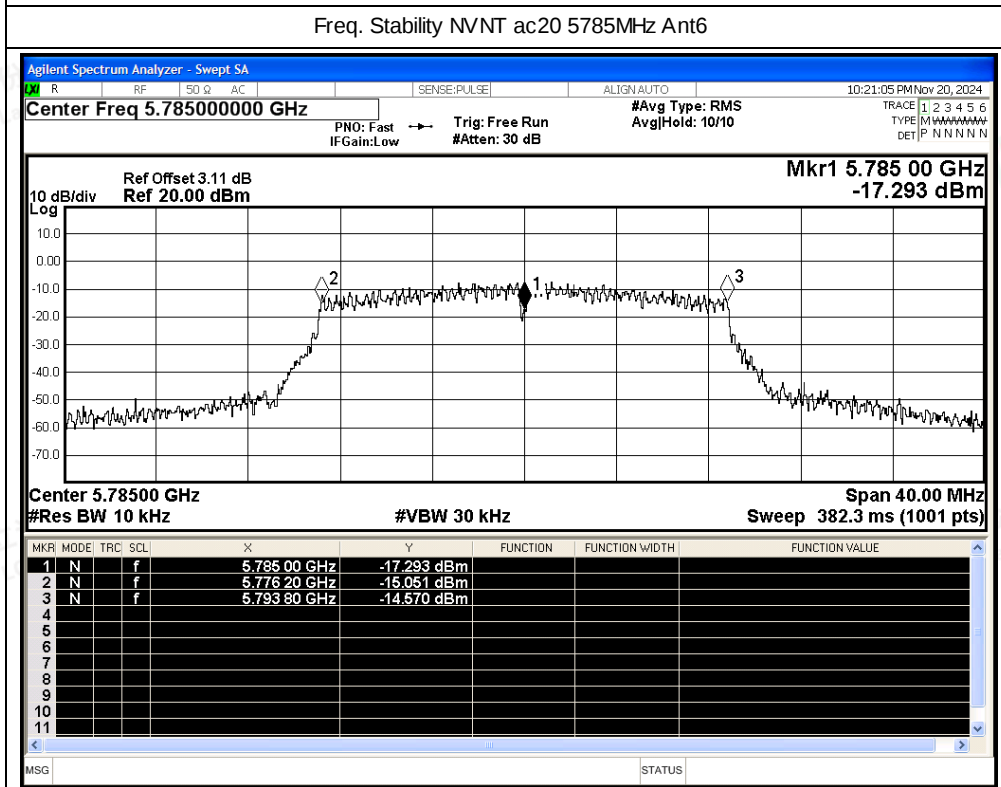
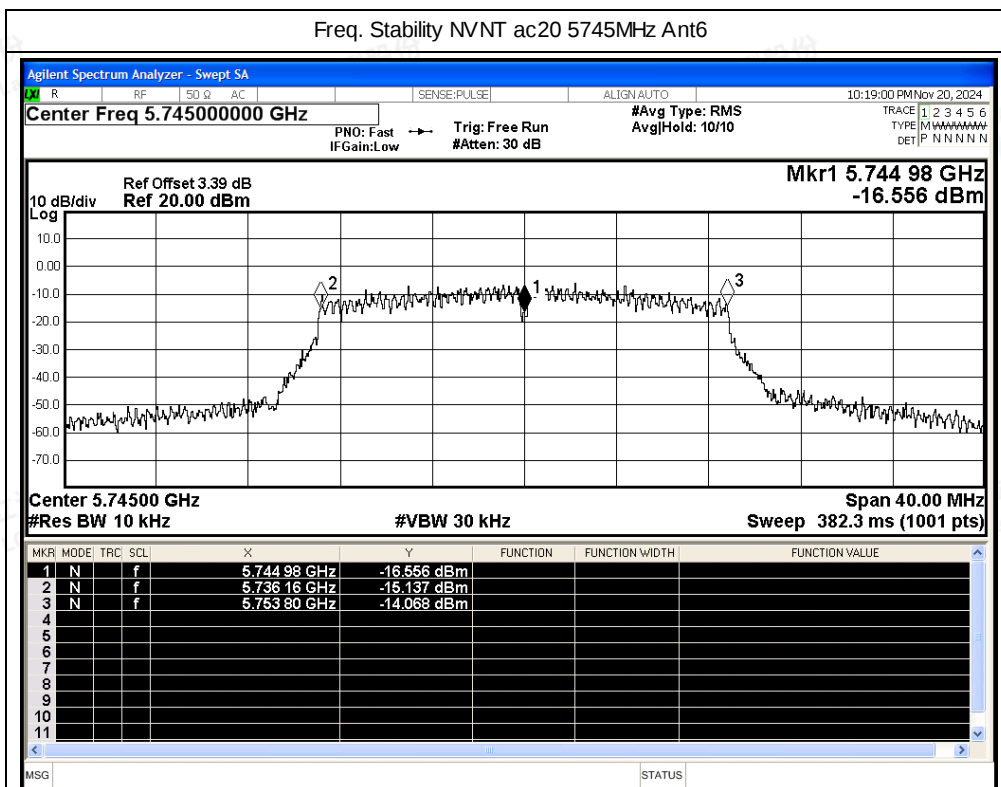


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

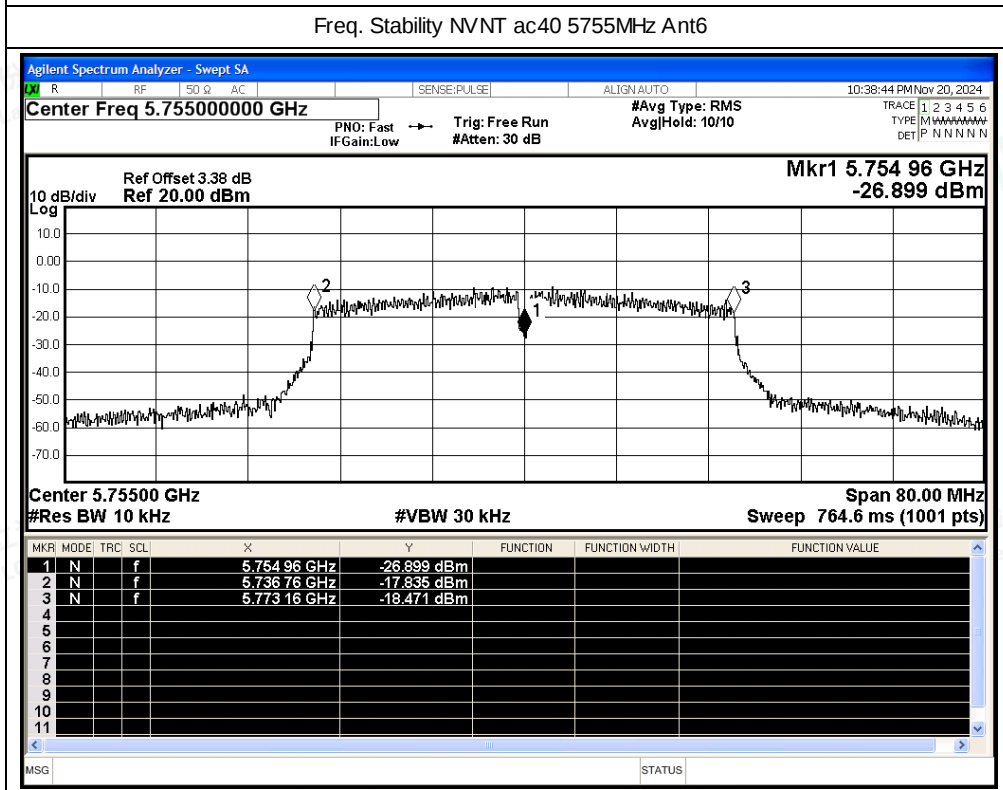
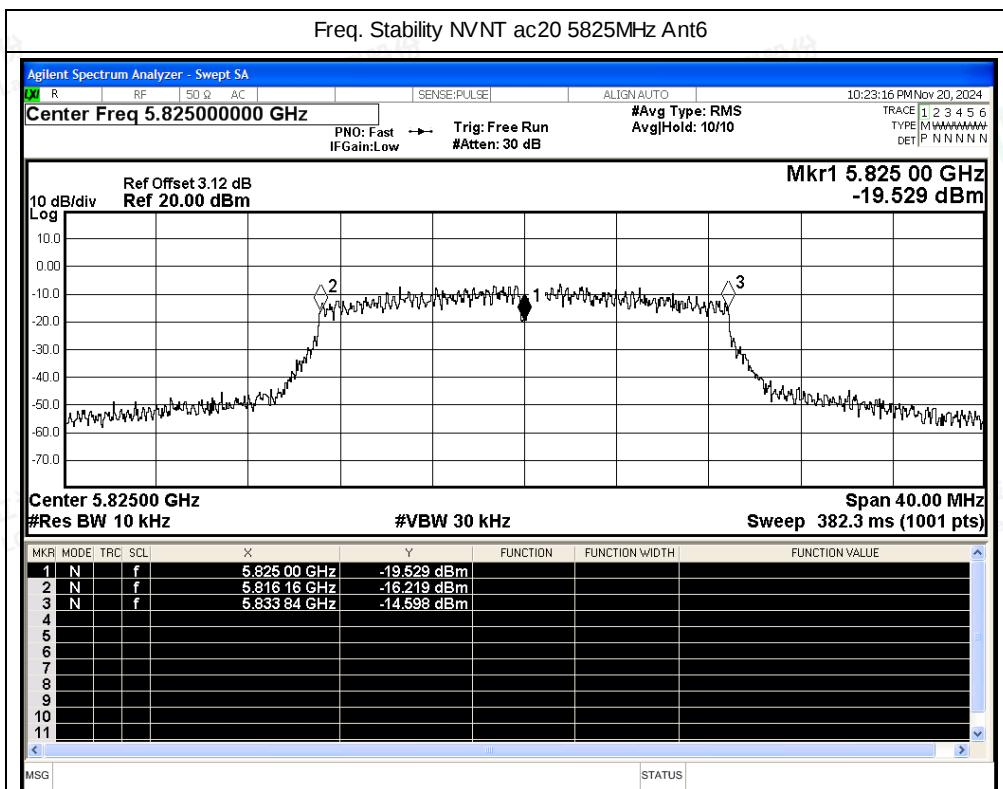




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

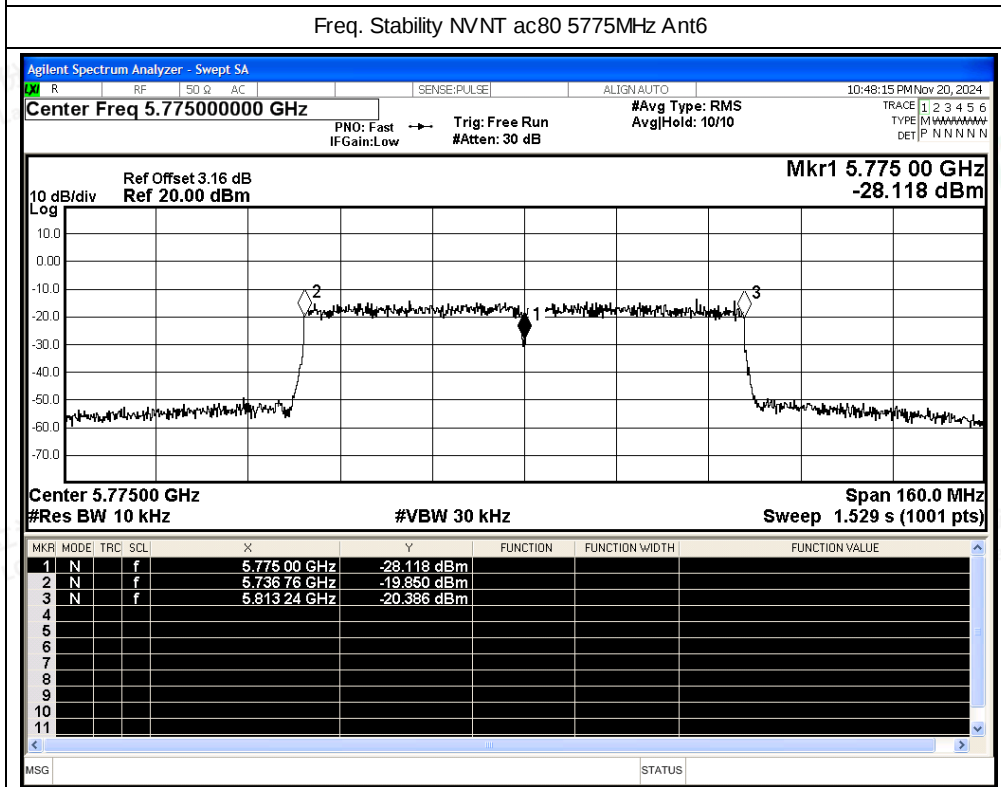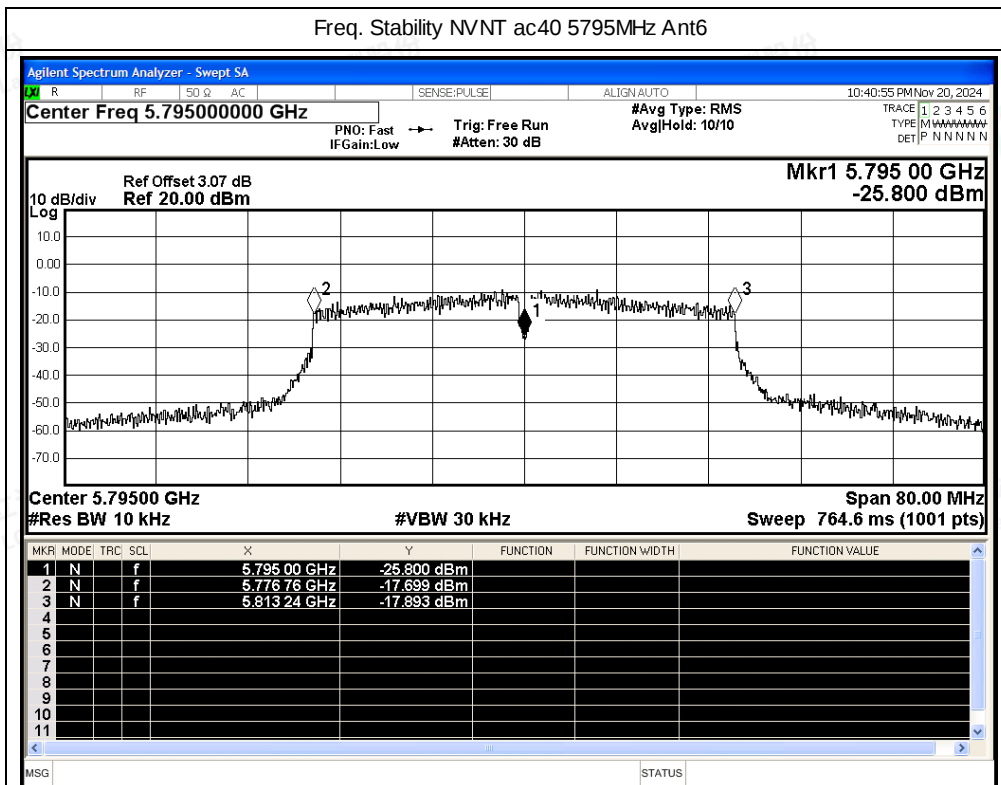

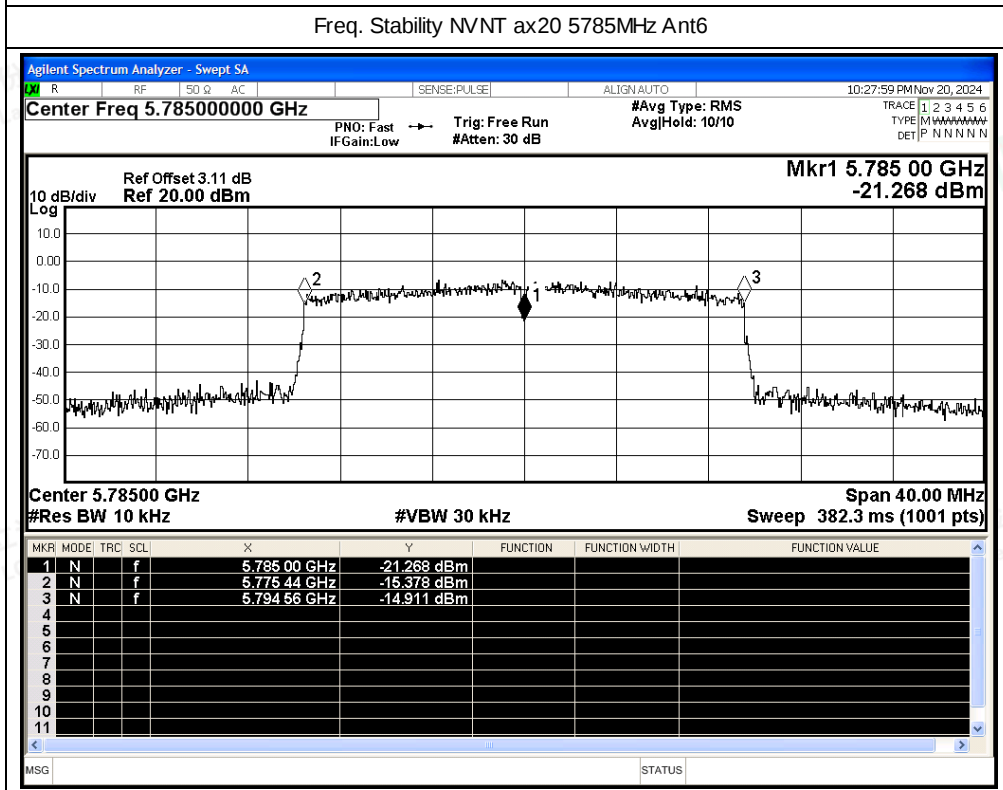
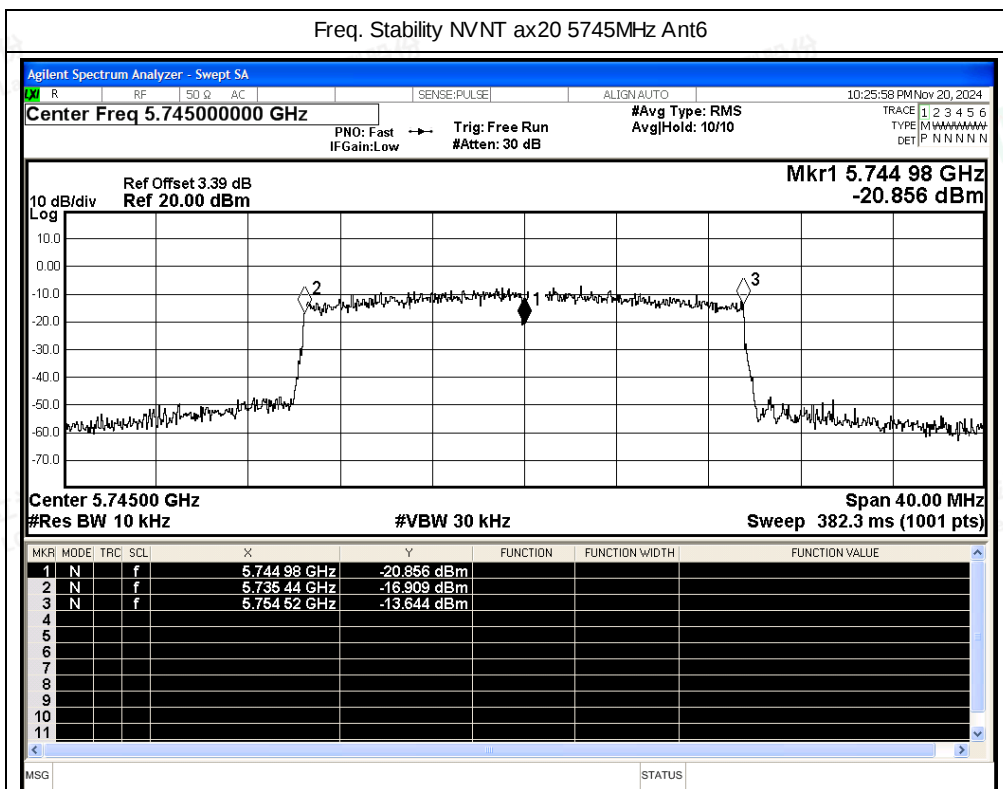


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

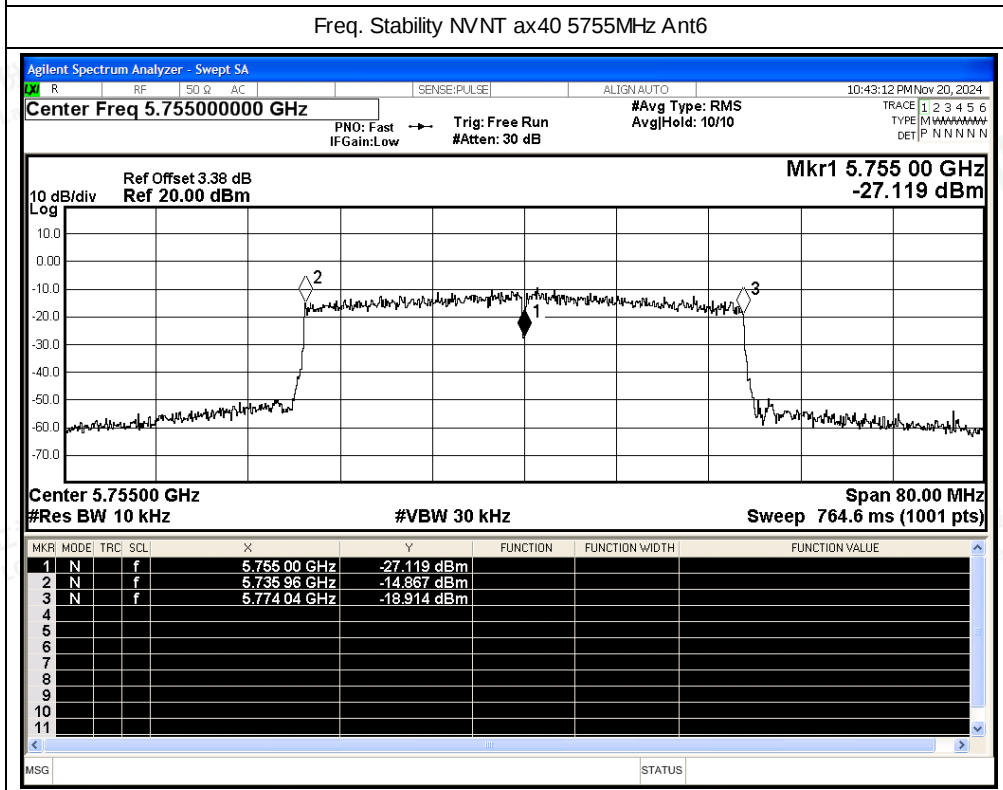
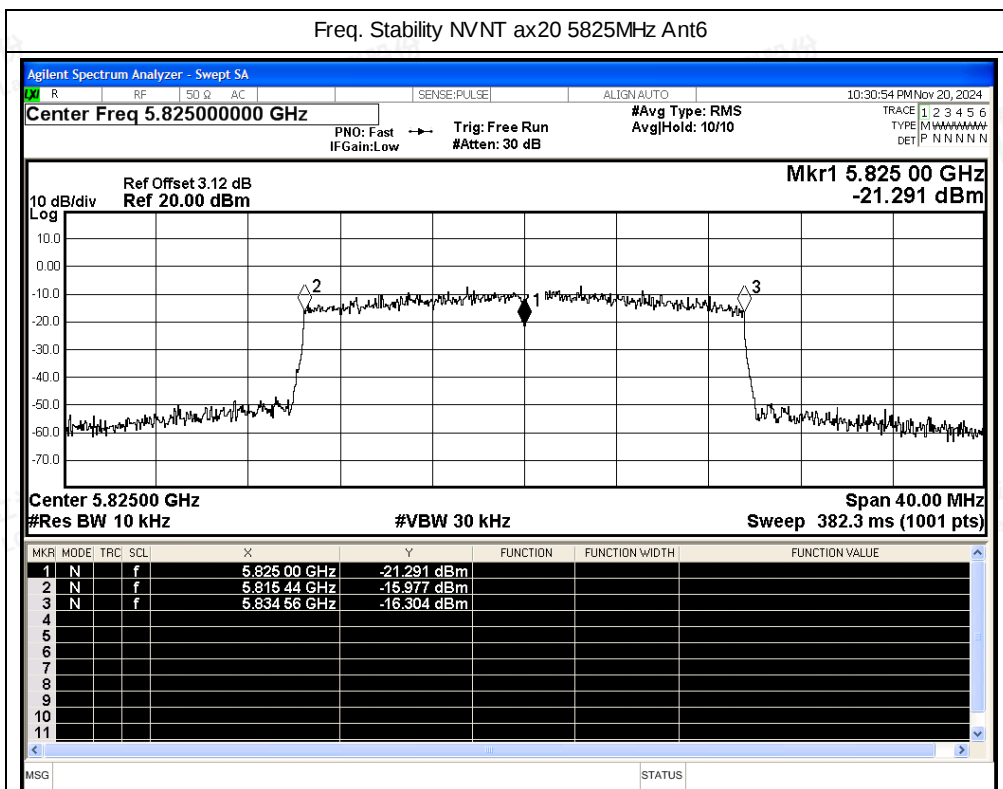


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

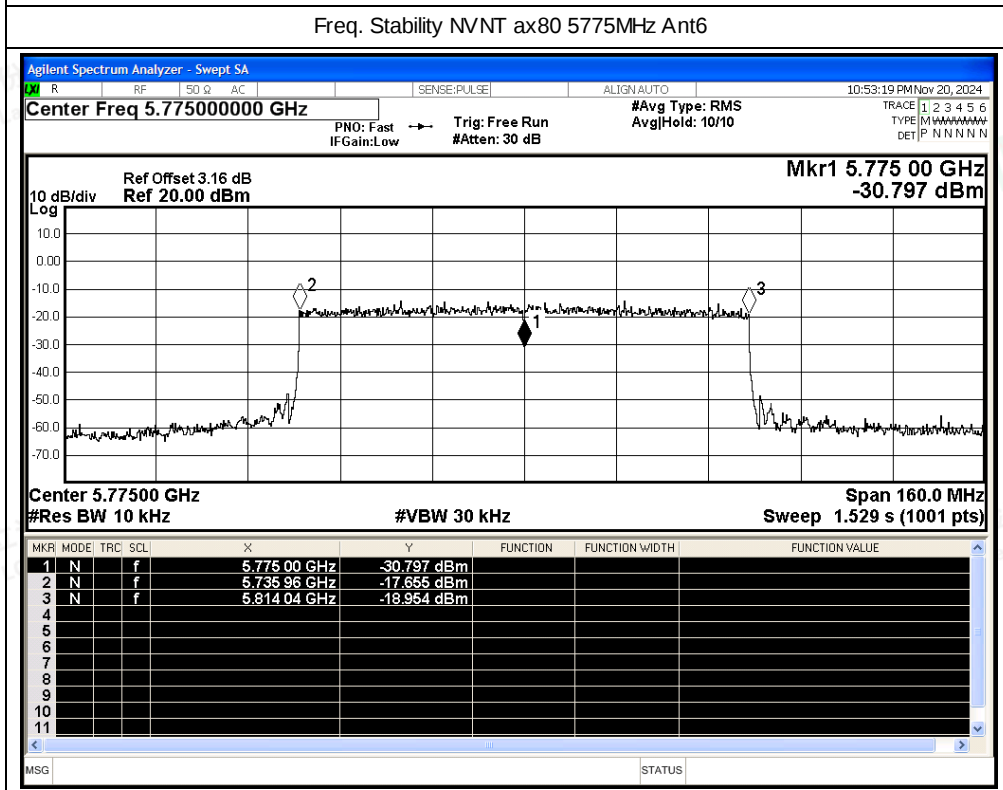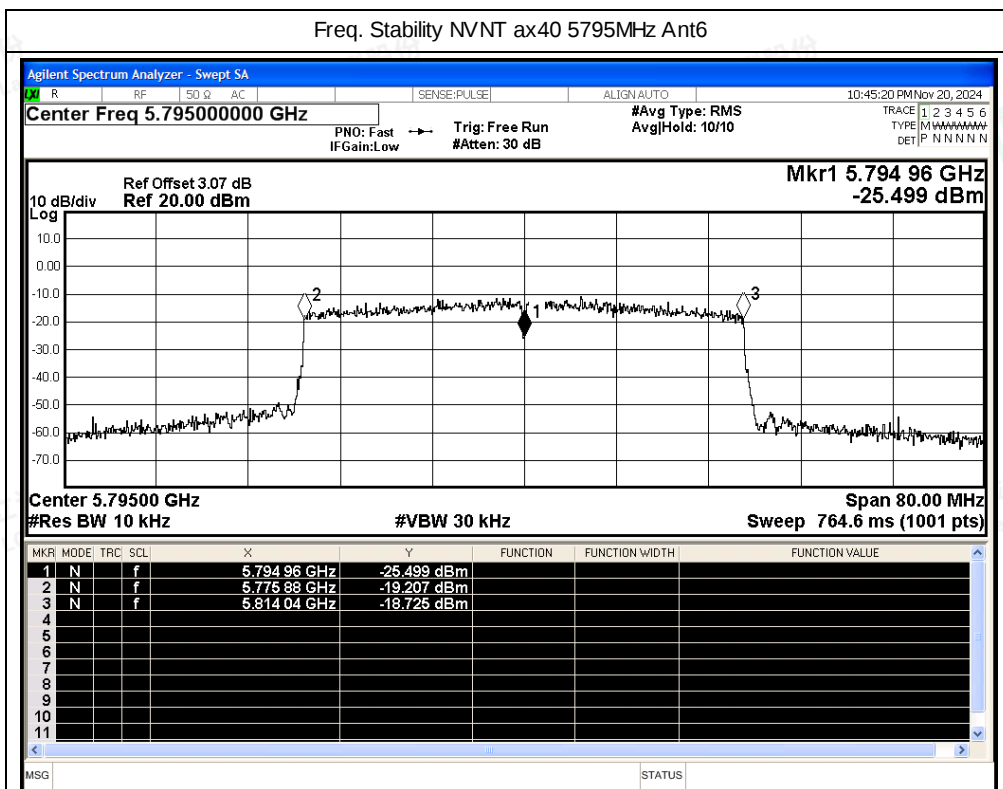

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5745            | Ant7    | 5745                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a    | 5785            | Ant7    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | a    | 5825            | Ant7    | 5824.96                  | -40000               | -6.87           | 25          | Pass    |
| NVNT      | n20  | 5745            | Ant7    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | n20  | 5785            | Ant7    | 5784.96                  | -40000               | -6.91           | 25          | Pass    |
| NVNT      | n20  | 5825            | Ant7    | 5825                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40  | 5755            | Ant7    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | n40  | 5795            | Ant7    | 5795                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5745            | Ant7    | 5744.96                  | -40000               | -6.96           | 25          | Pass    |
| NVNT      | ac20 | 5785            | Ant7    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | ac20 | 5825            | Ant7    | 5825                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5755            | Ant7    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | ac40 | 5795            | Ant7    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ac80 | 5775            | Ant7    | 5775                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5745            | Ant7    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ax20 | 5785            | Ant7    | 5785                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5825            | Ant7    | 5825                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40 | 5755            | Ant7    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | ax40 | 5795            | Ant7    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ax80 | 5775            | Ant7    | 5775                     | 0                    | 0               | 25          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Freq. Stability NVNT a 5745MHz Ant7

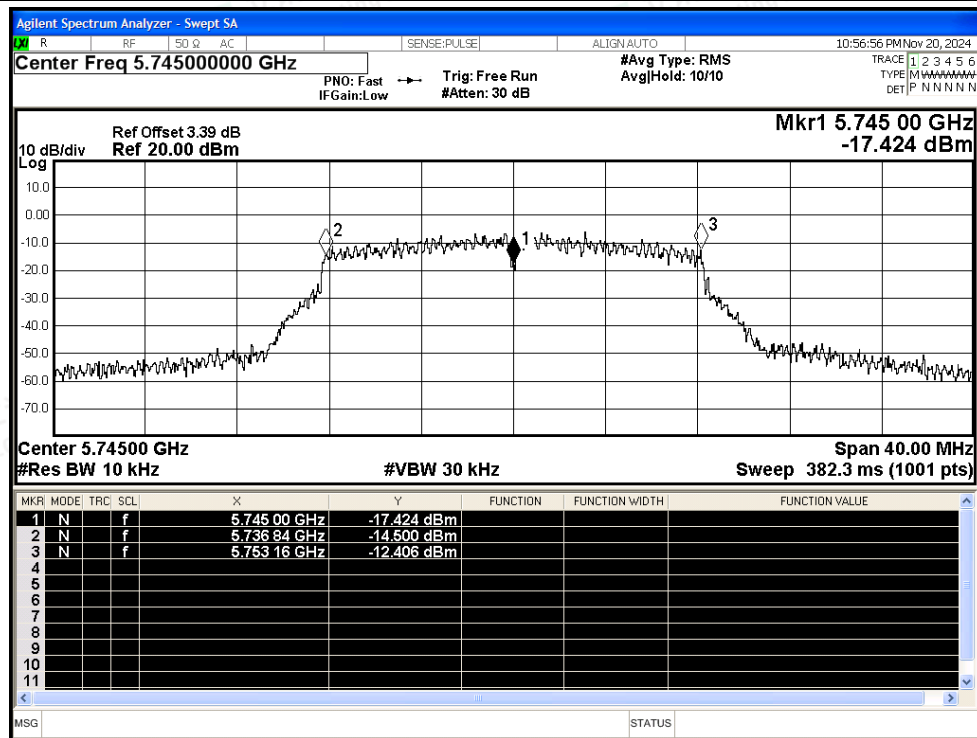

## Freq. Stability NVNT a 5785MHz Ant7

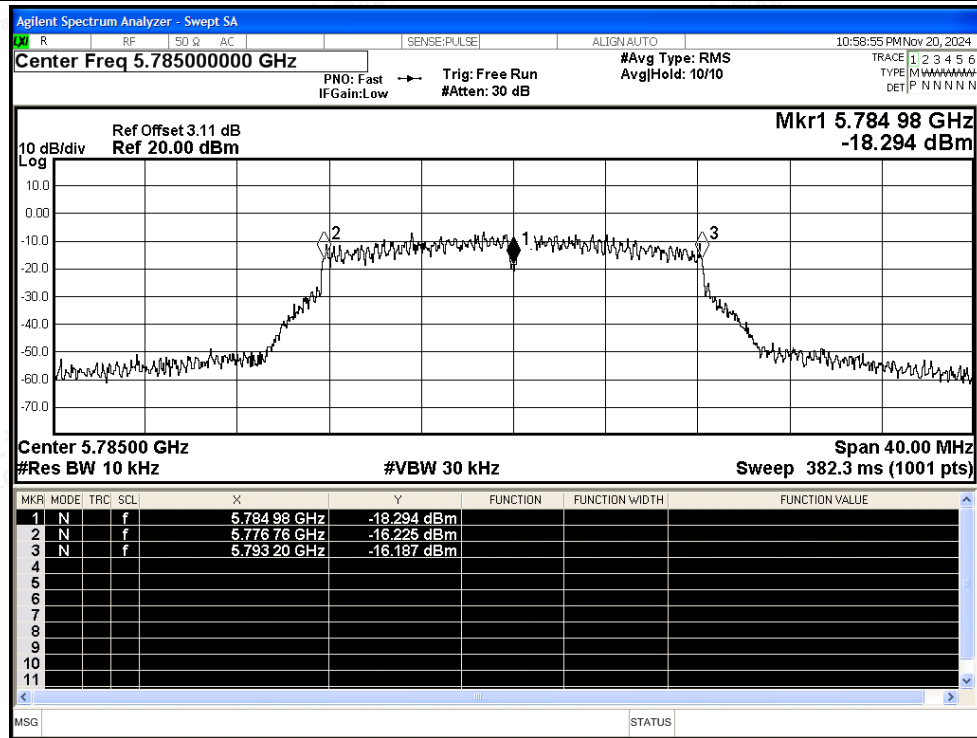

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT a 5825MHz Ant7

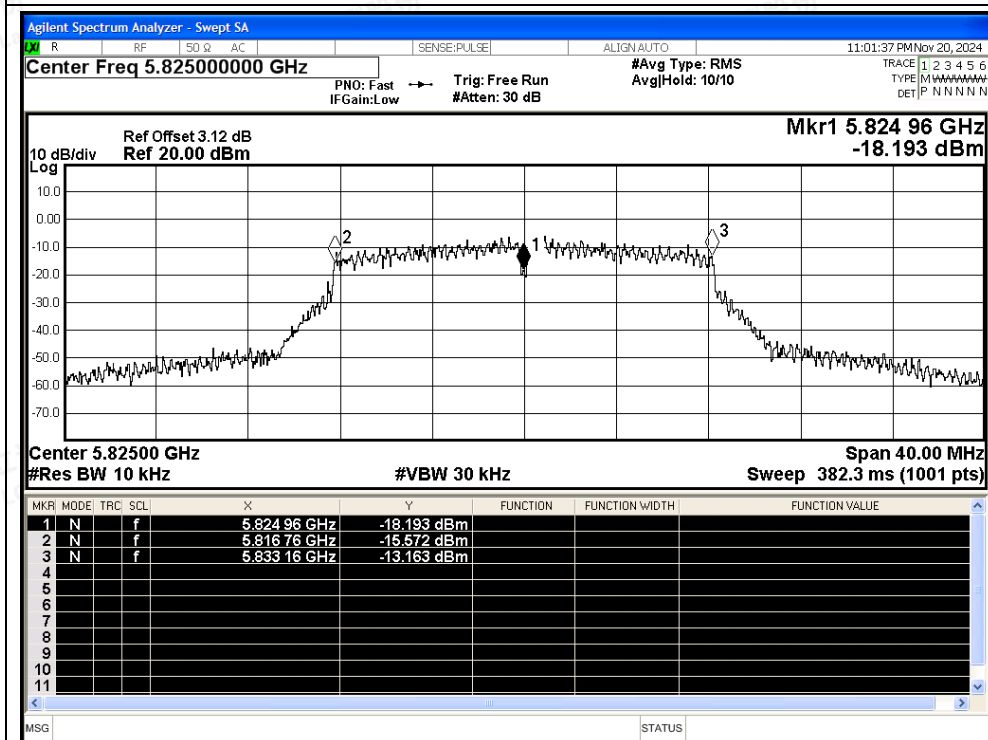

## Freq. Stability NVNT n20 5745MHz Ant7


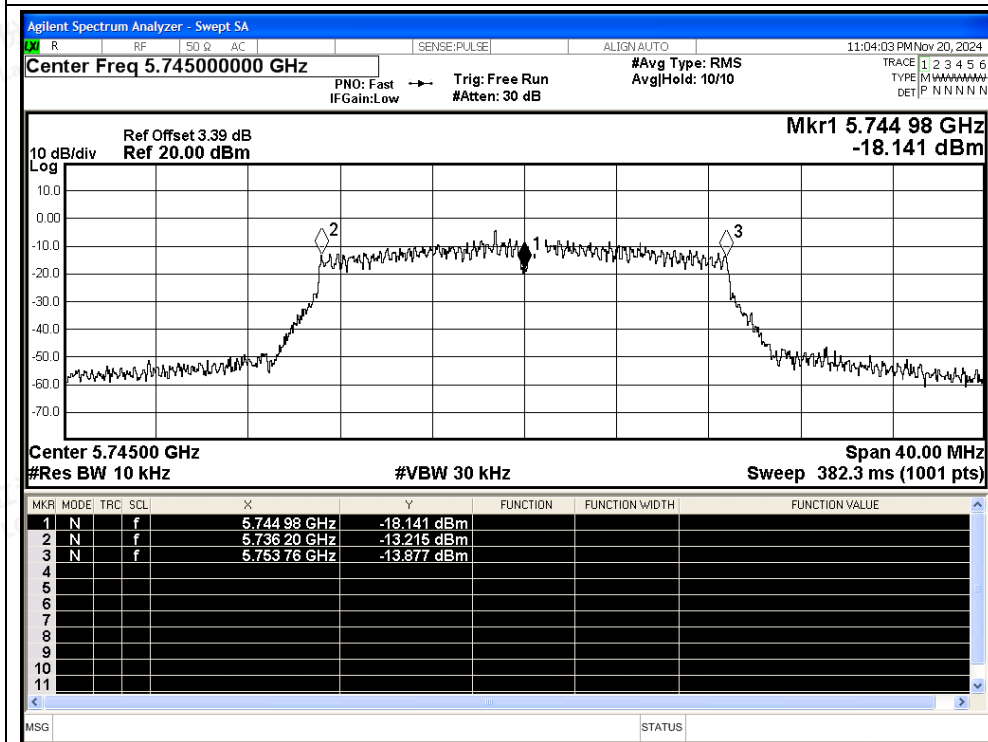


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

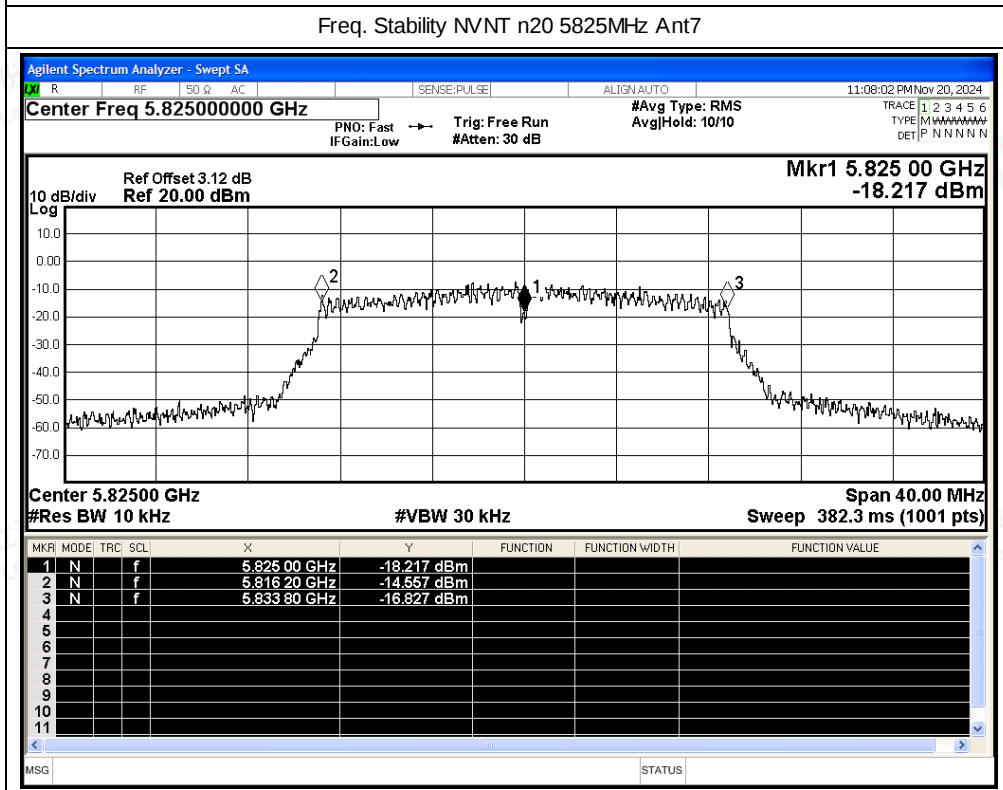
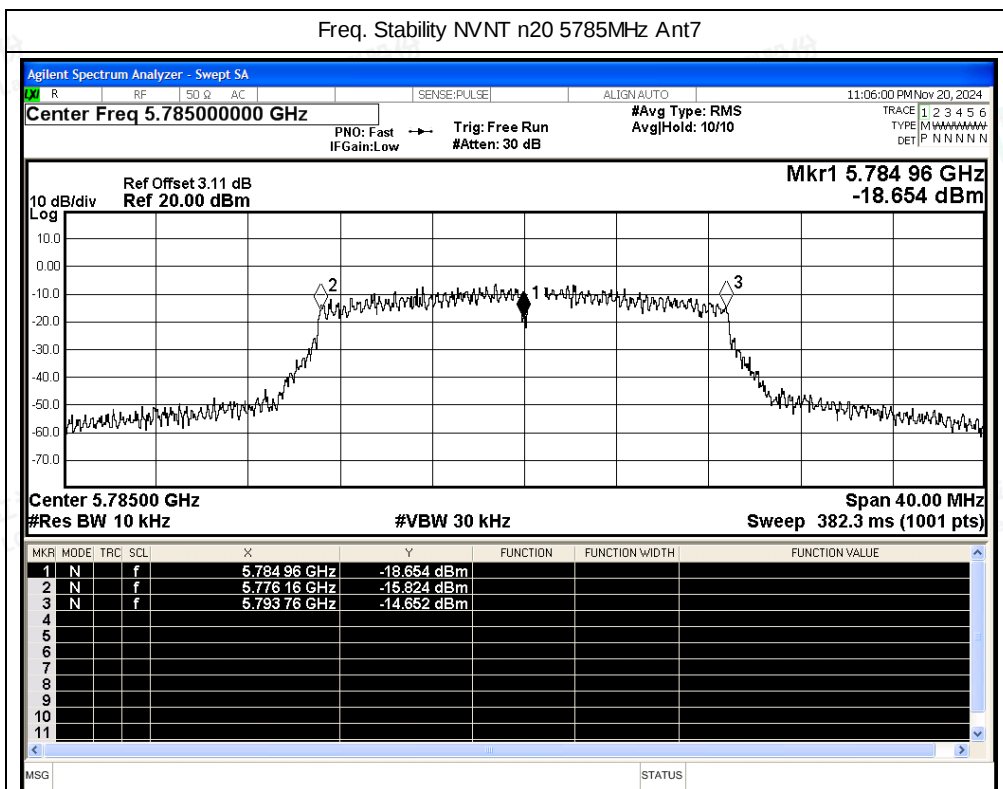


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

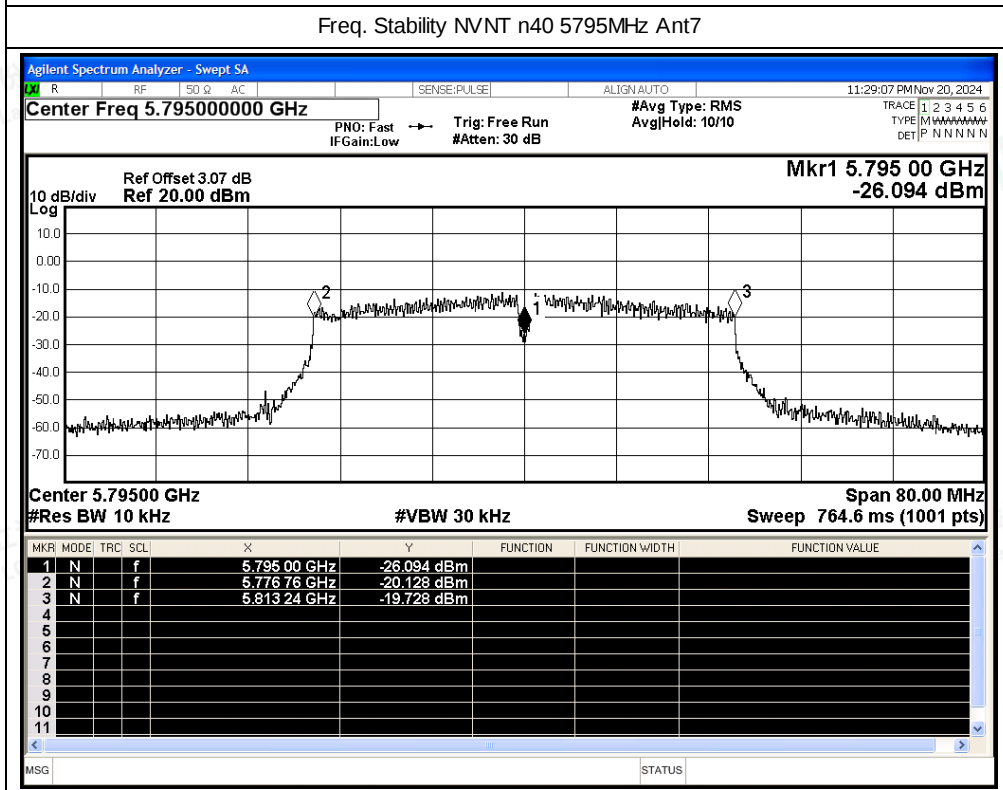
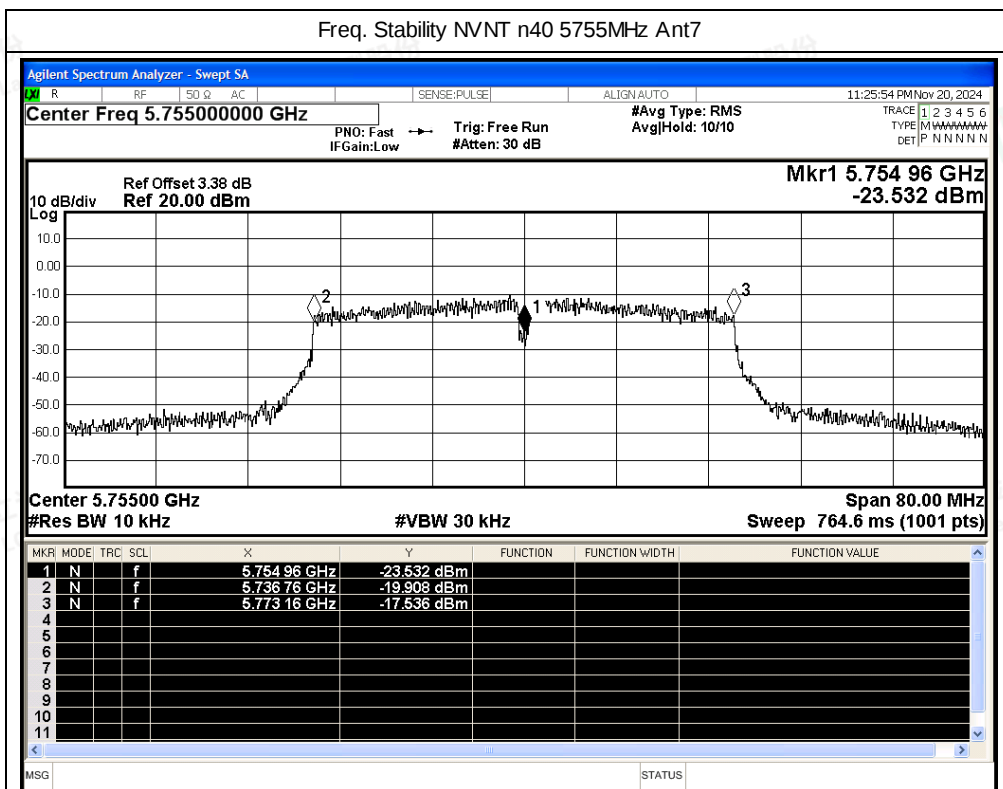


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

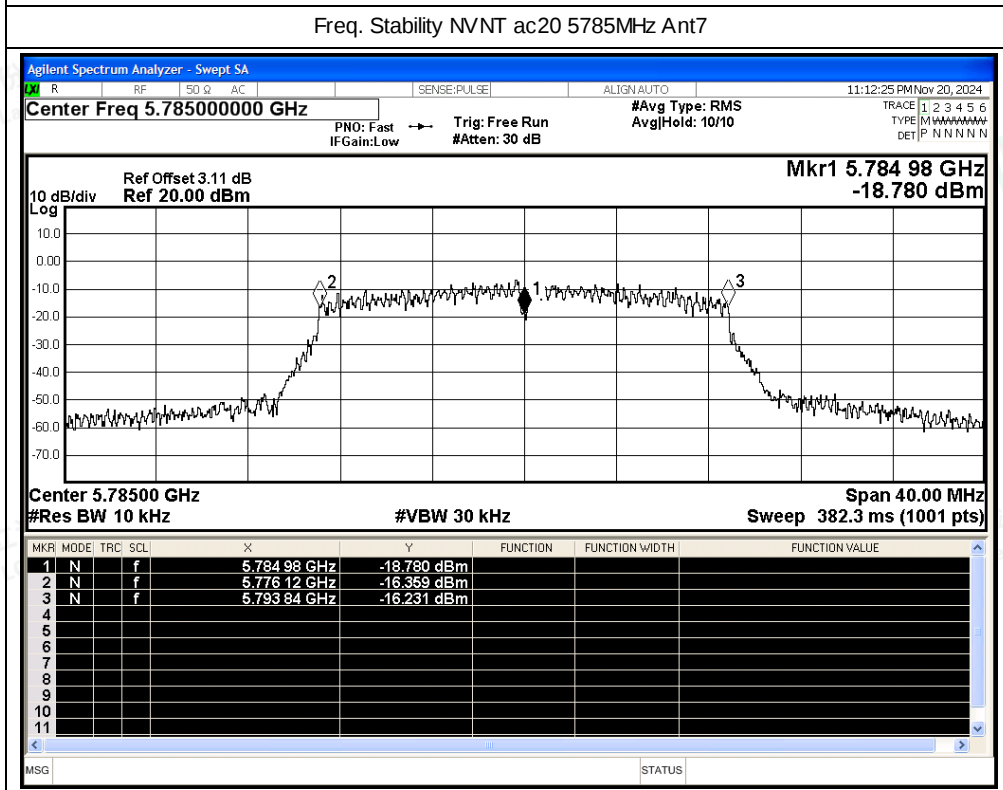
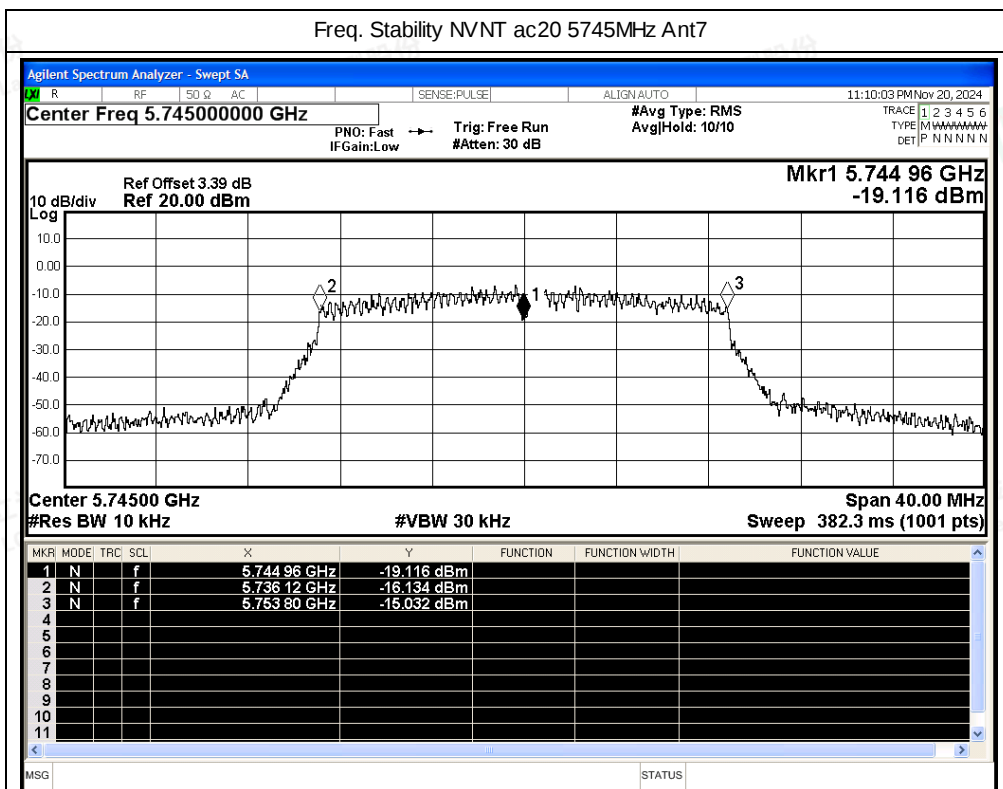


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

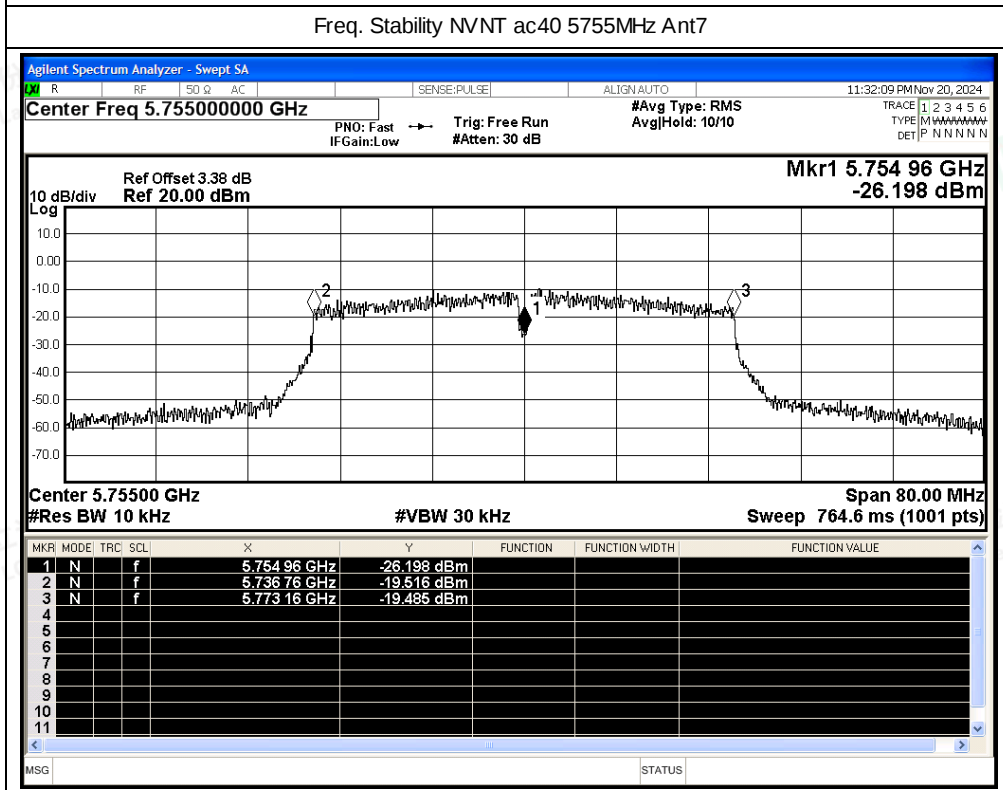
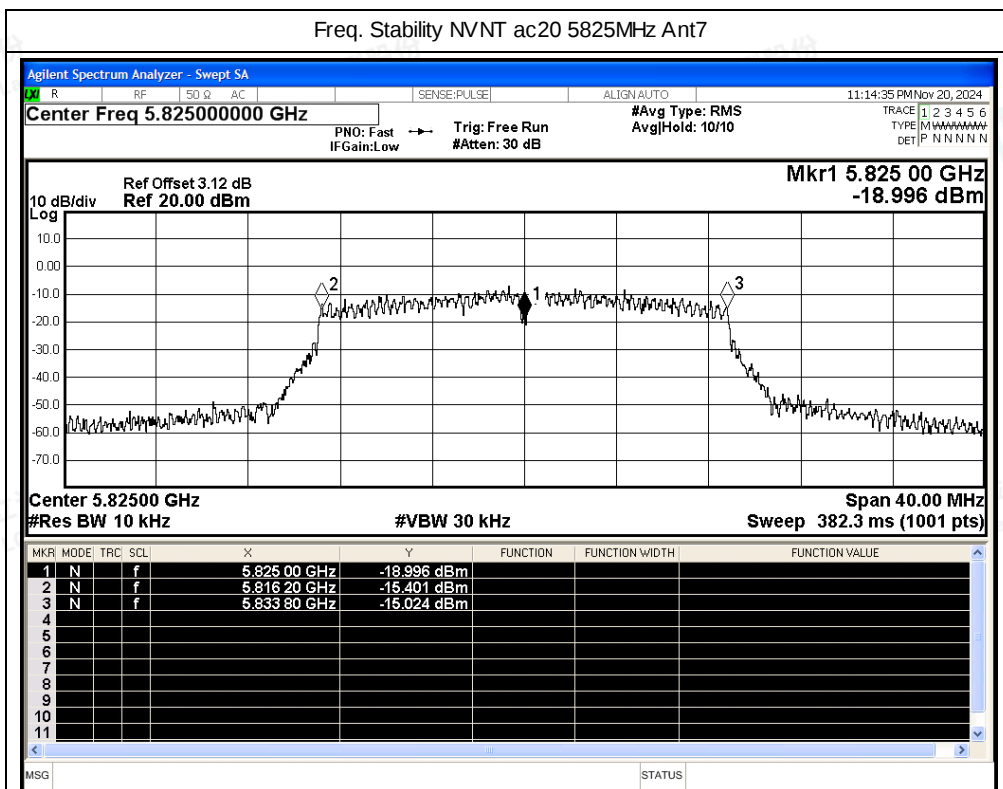


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

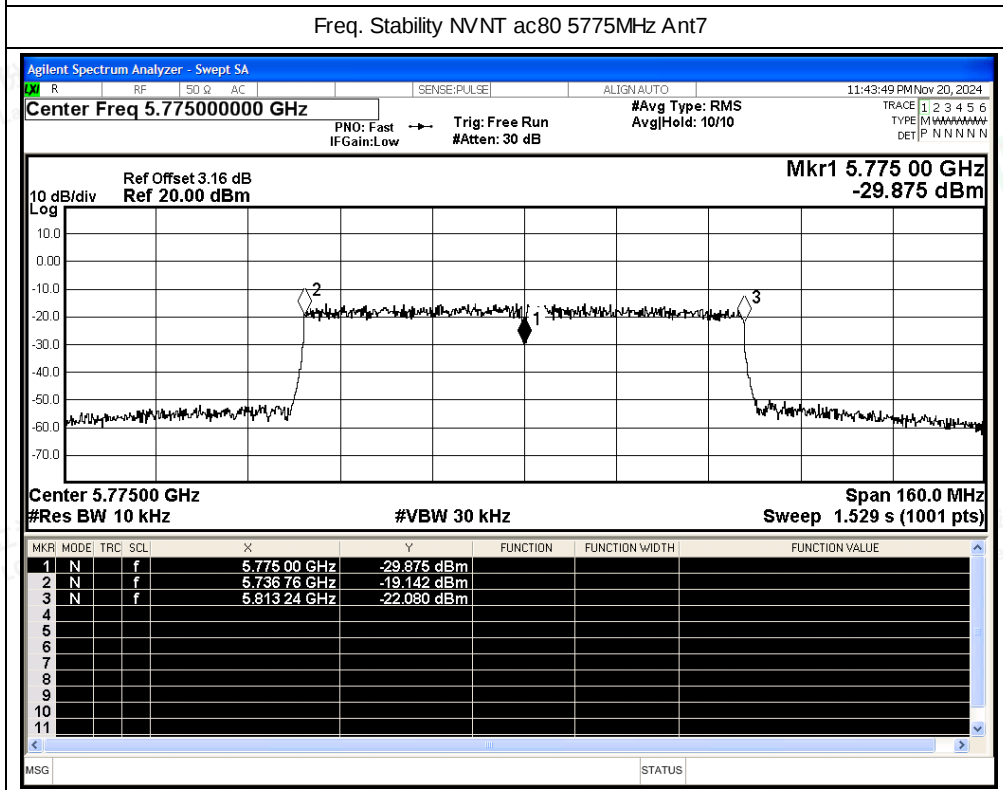
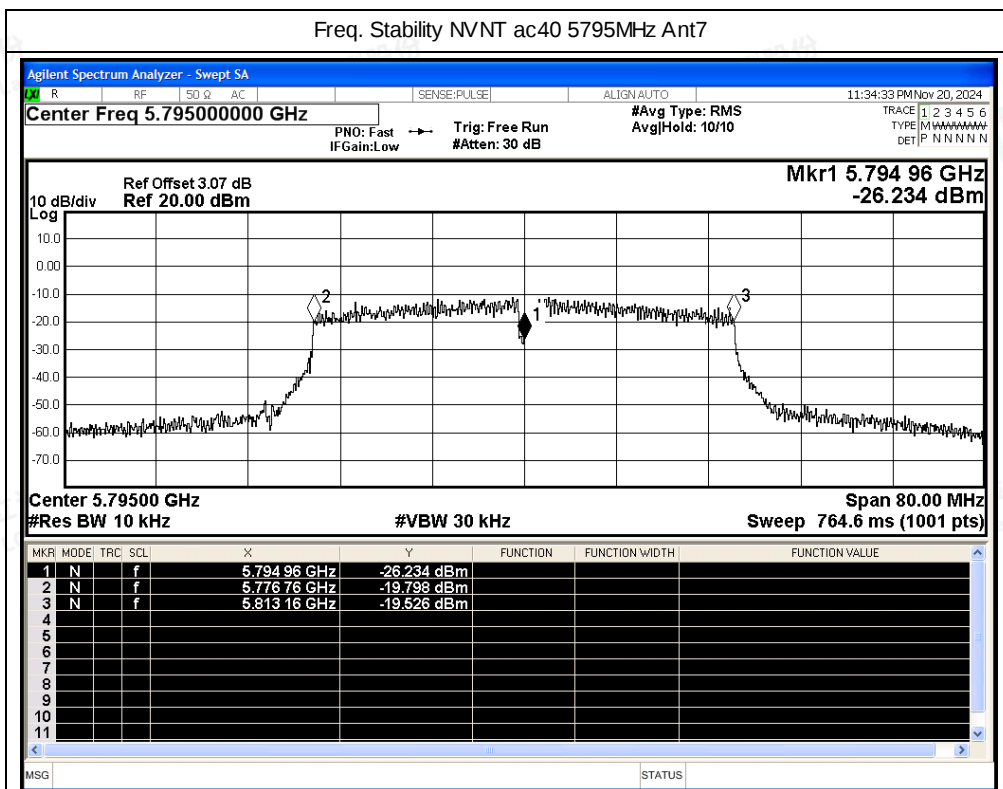


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

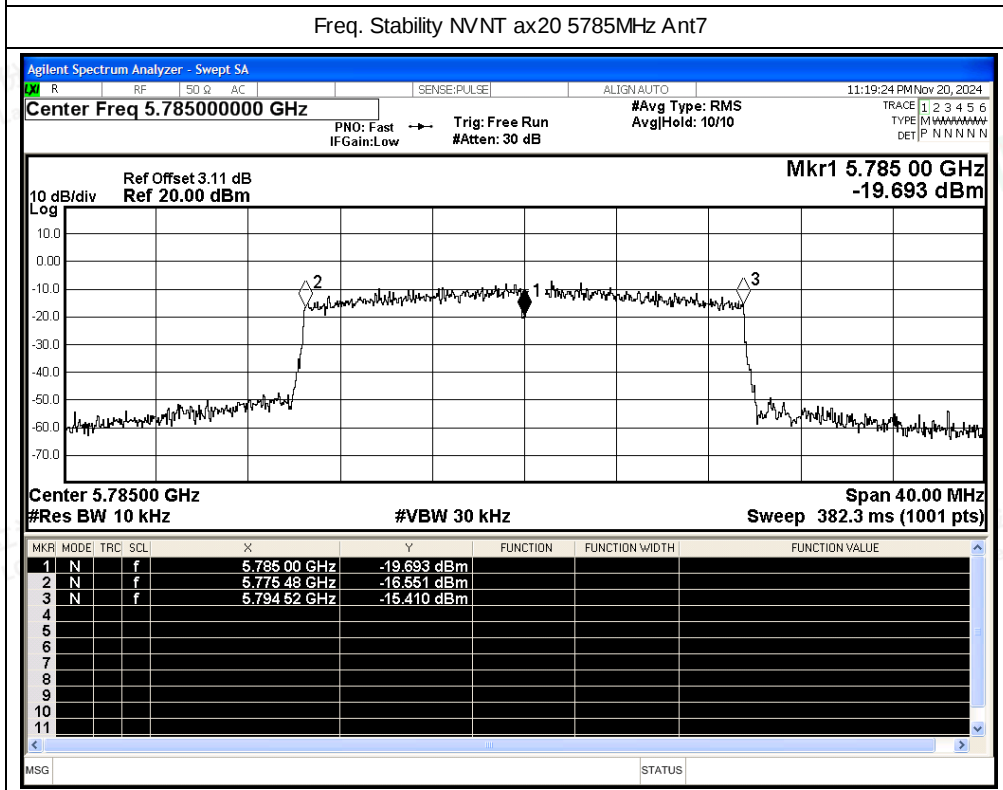
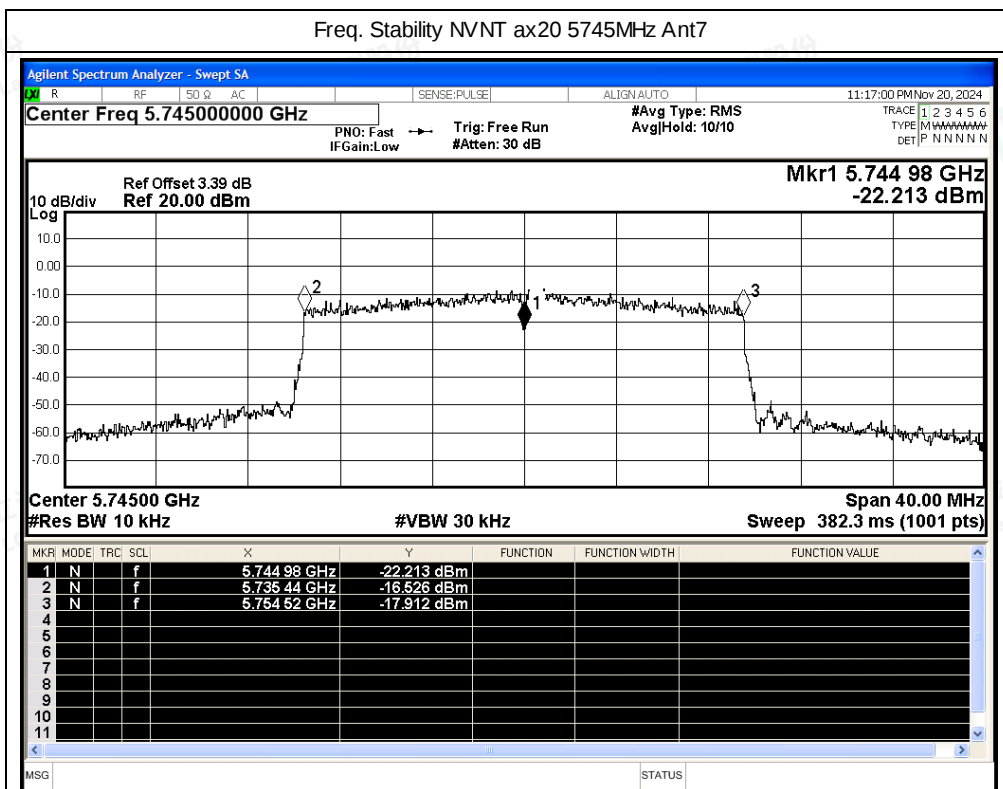


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

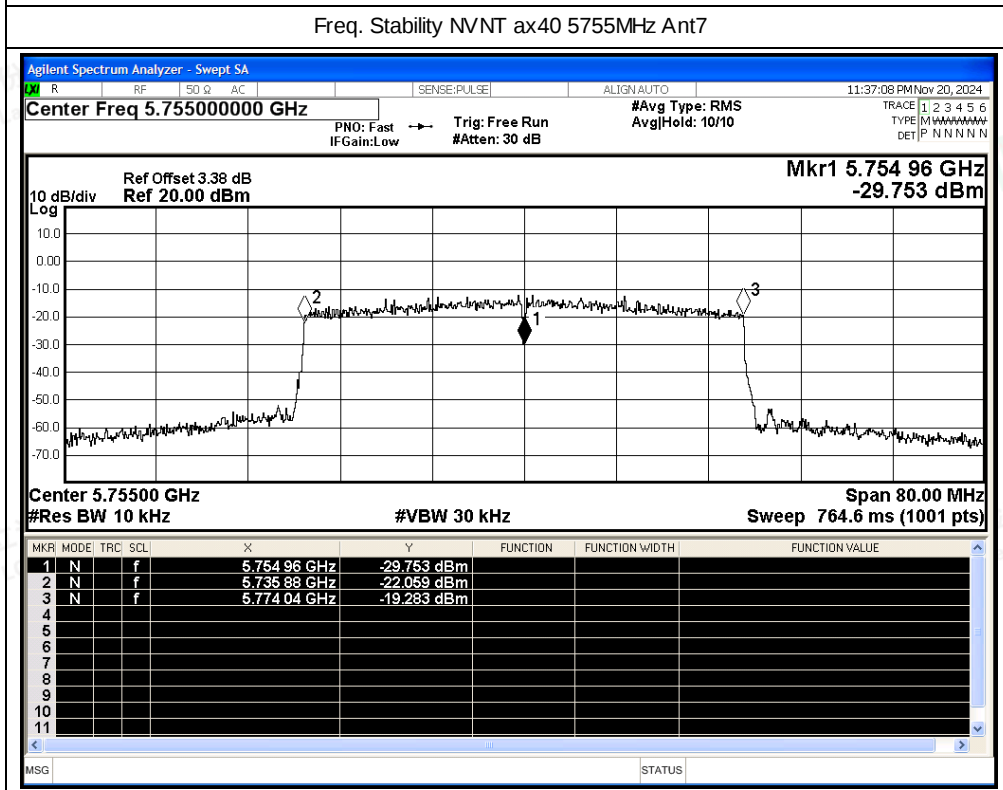
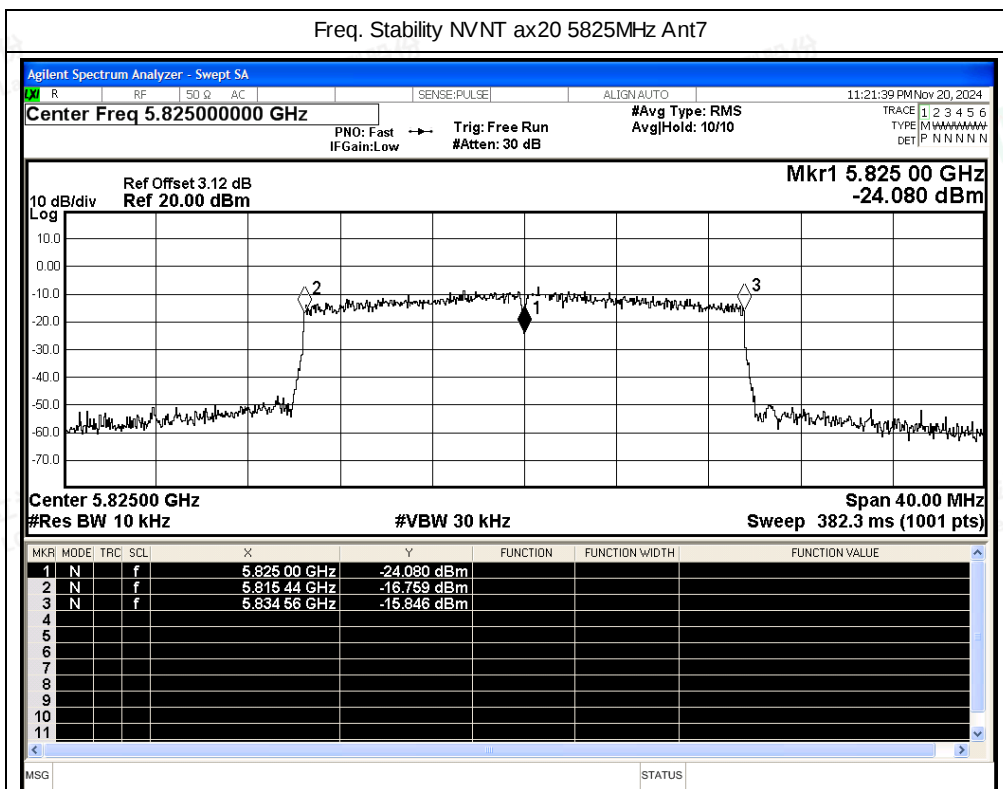


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

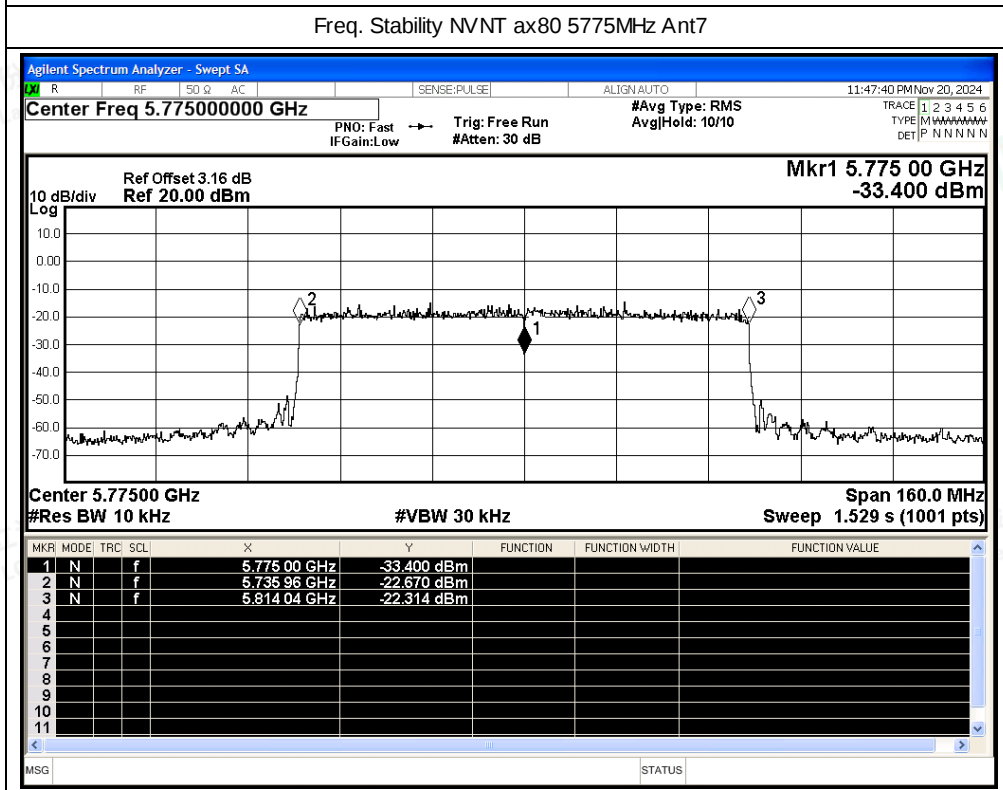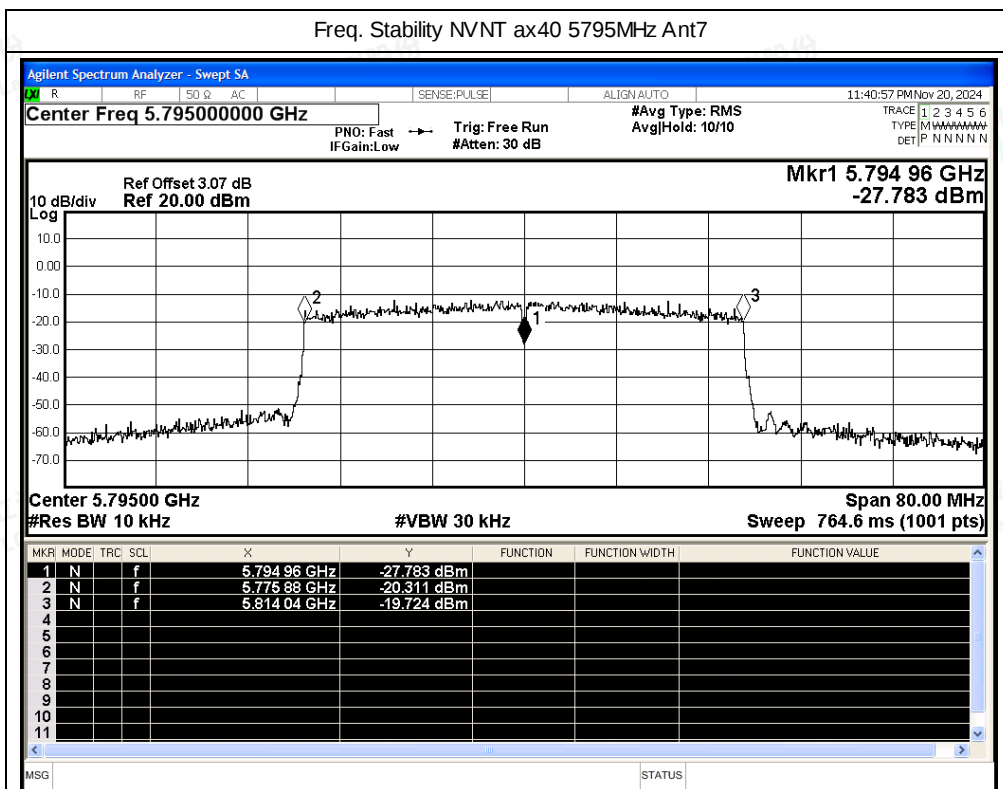

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.6 Duty Cycle


| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant6    | 58.46          | 2.33                   | 0.72      |
| NVNT      | a    | 5785            | Ant6    | 58.73          | 2.31                   | 0.72      |
| NVNT      | a    | 5825            | Ant6    | 58.5           | 2.33                   | 0.72      |
| NVNT      | n20  | 5745            | Ant6    | 56.84          | 2.45                   | 0.77      |
| NVNT      | n20  | 5785            | Ant6    | 56.79          | 2.46                   | 0.77      |
| NVNT      | n20  | 5825            | Ant6    | 55.91          | 2.53                   | 0.77      |
| NVNT      | n40  | 5755            | Ant6    | 54.69          | 2.62                   | 0.82      |
| NVNT      | n40  | 5795            | Ant6    | 54.86          | 2.61                   | 0.82      |
| NVNT      | ac20 | 5745            | Ant6    | 56.99          | 2.44                   | 0.76      |
| NVNT      | ac20 | 5785            | Ant6    | 56.99          | 2.44                   | 0.76      |
| NVNT      | ac20 | 5825            | Ant6    | 56.99          | 2.44                   | 0.76      |
| NVNT      | ac40 | 5755            | Ant6    | 55.02          | 2.59                   | 0.81      |
| NVNT      | ac40 | 5795            | Ant6    | 55.02          | 2.59                   | 0.81      |
| NVNT      | ac80 | 5775            | Ant6    | 51.78          | 2.86                   | 0.88      |
| NVNT      | ax20 | 5745            | Ant6    | 50.65          | 2.95                   | 0.99      |
| NVNT      | ax20 | 5785            | Ant6    | 51.34          | 2.9                    | 0.99      |
| NVNT      | ax20 | 5825            | Ant6    | 50.67          | 2.95                   | 0.99      |
| NVNT      | ax40 | 5755            | Ant6    | 49.4           | 3.06                   | 1.01      |
| NVNT      | ax40 | 5795            | Ant6    | 49.62          | 3.04                   | 1.01      |
| NVNT      | ax80 | 5775            | Ant6    | 47.16          | 3.26                   | 1.06      |






## Test Graphs

## Duty Cycle NVNT a 5745MHz Ant6

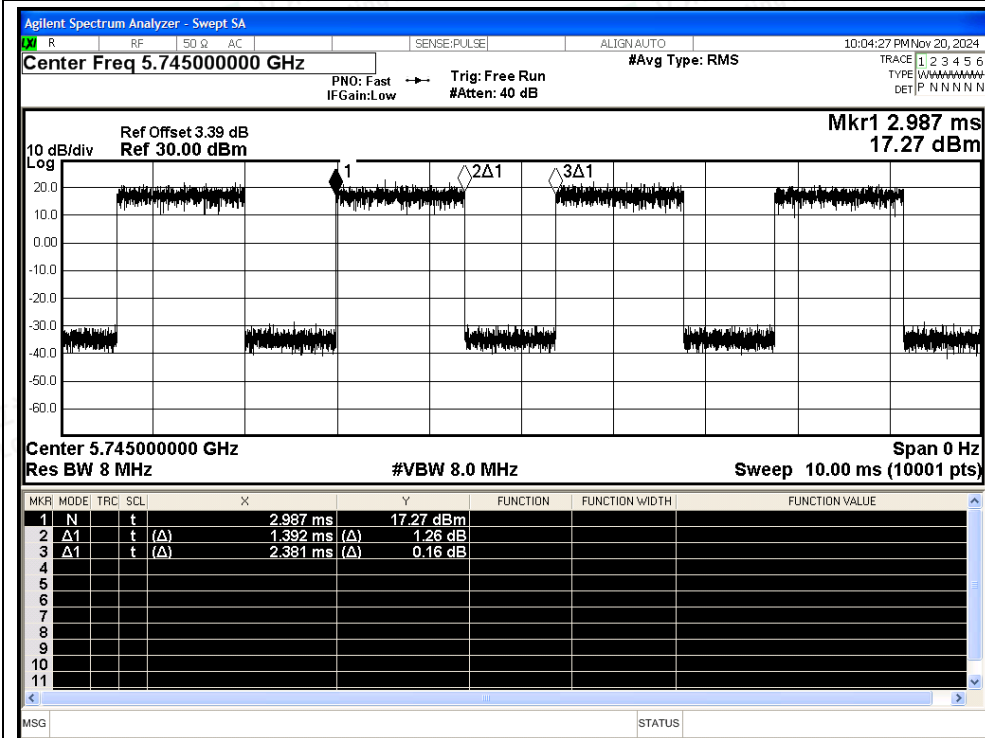

## Duty Cycle NVNT a 5785MHz Ant6


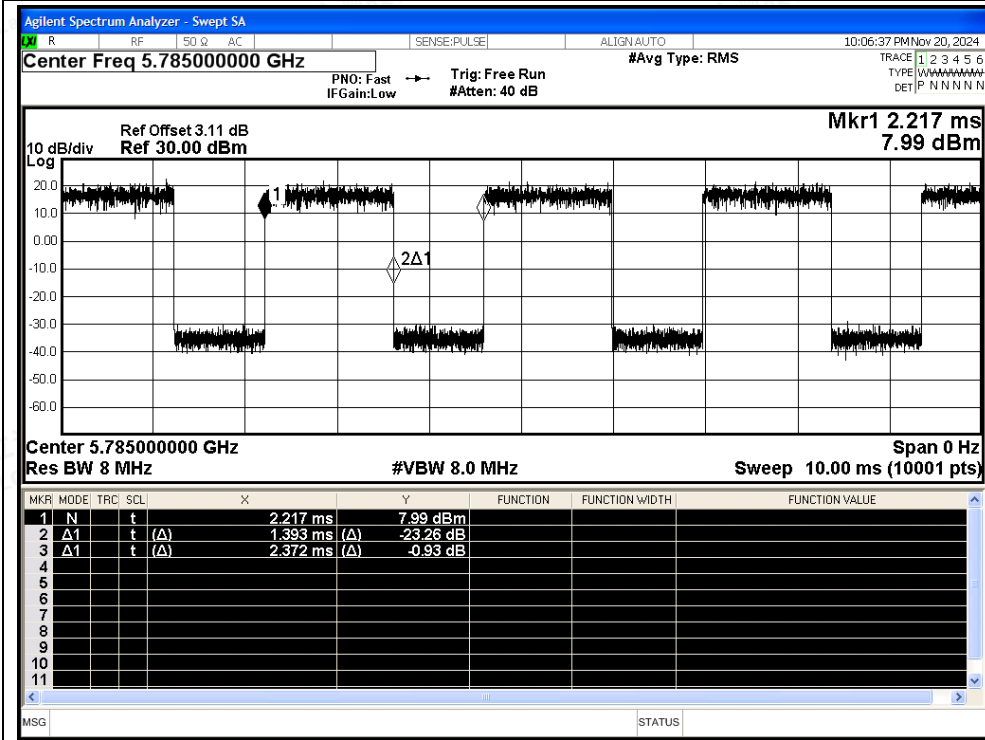


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

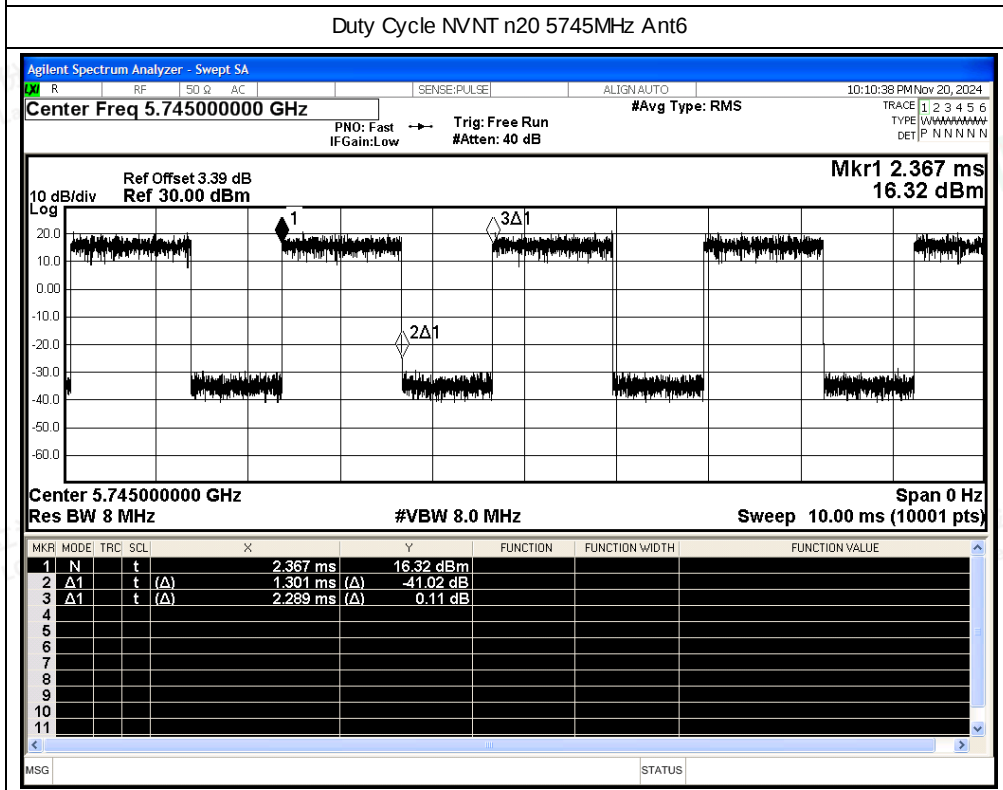
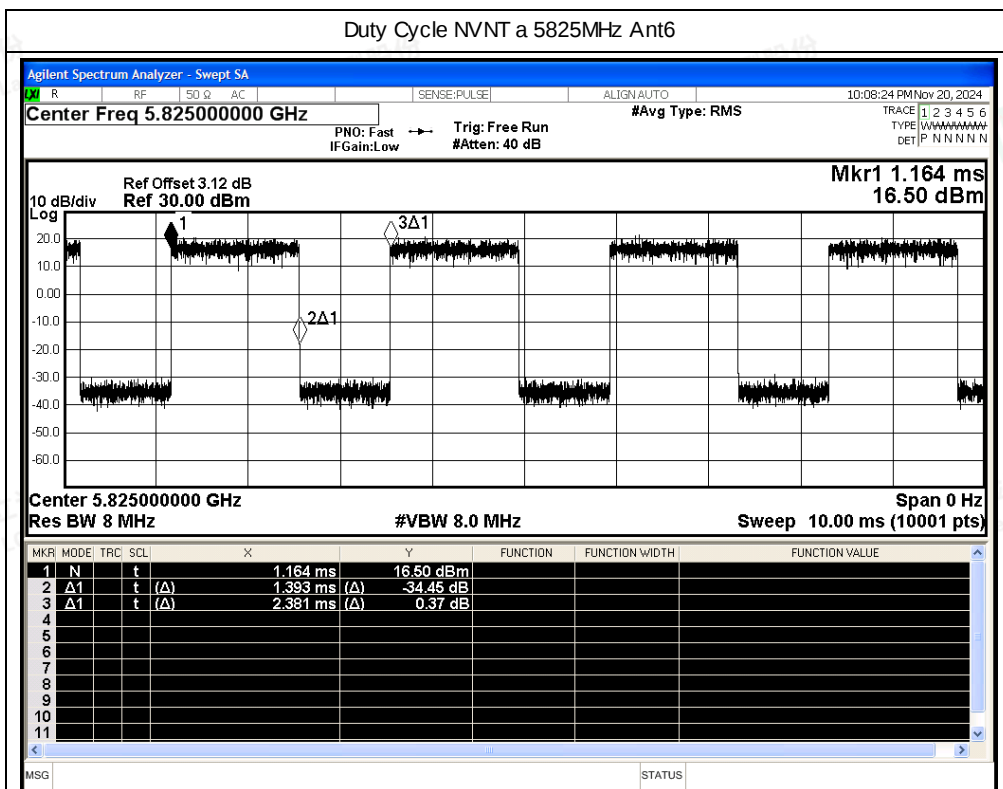


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

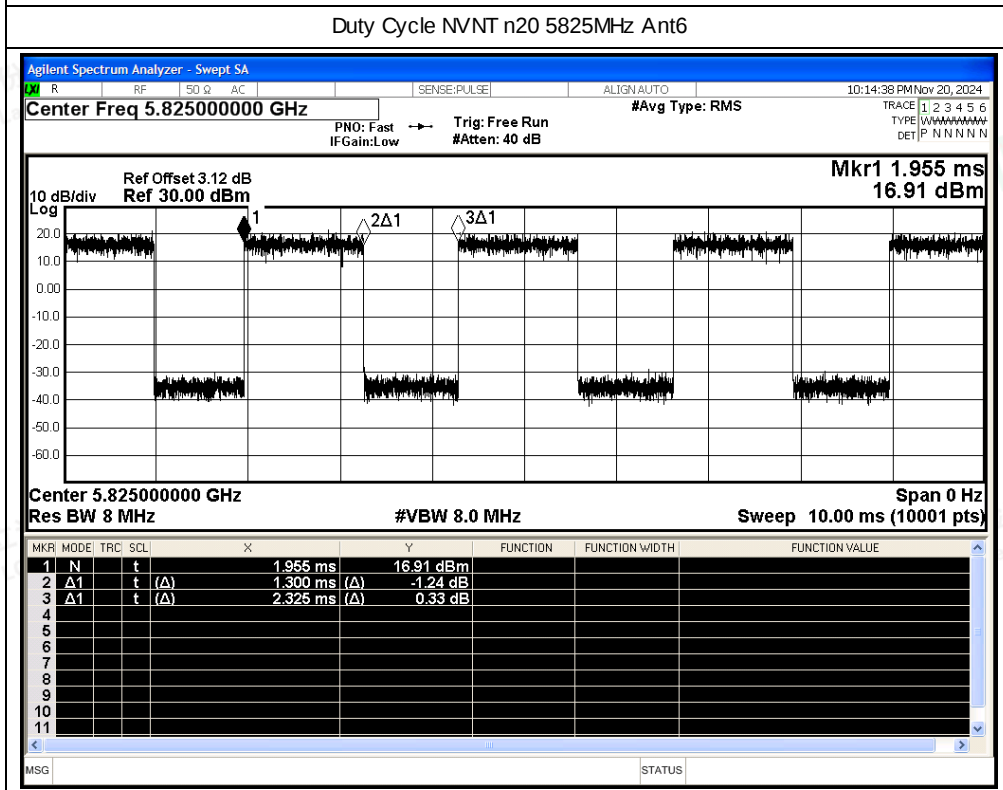
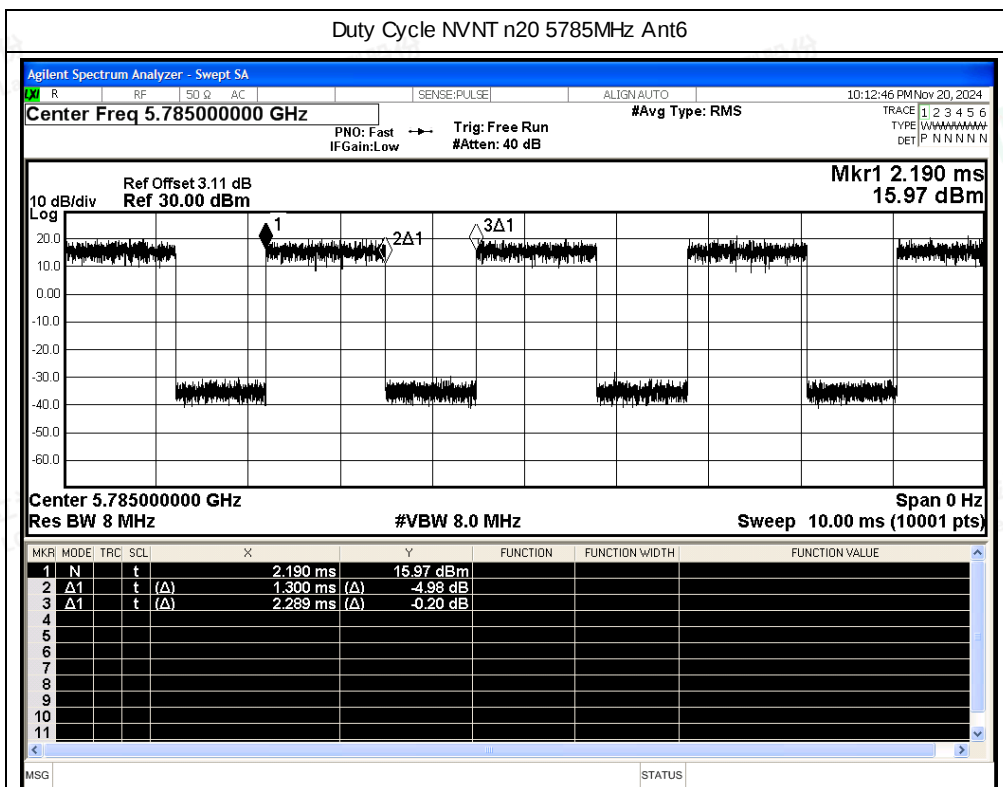


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

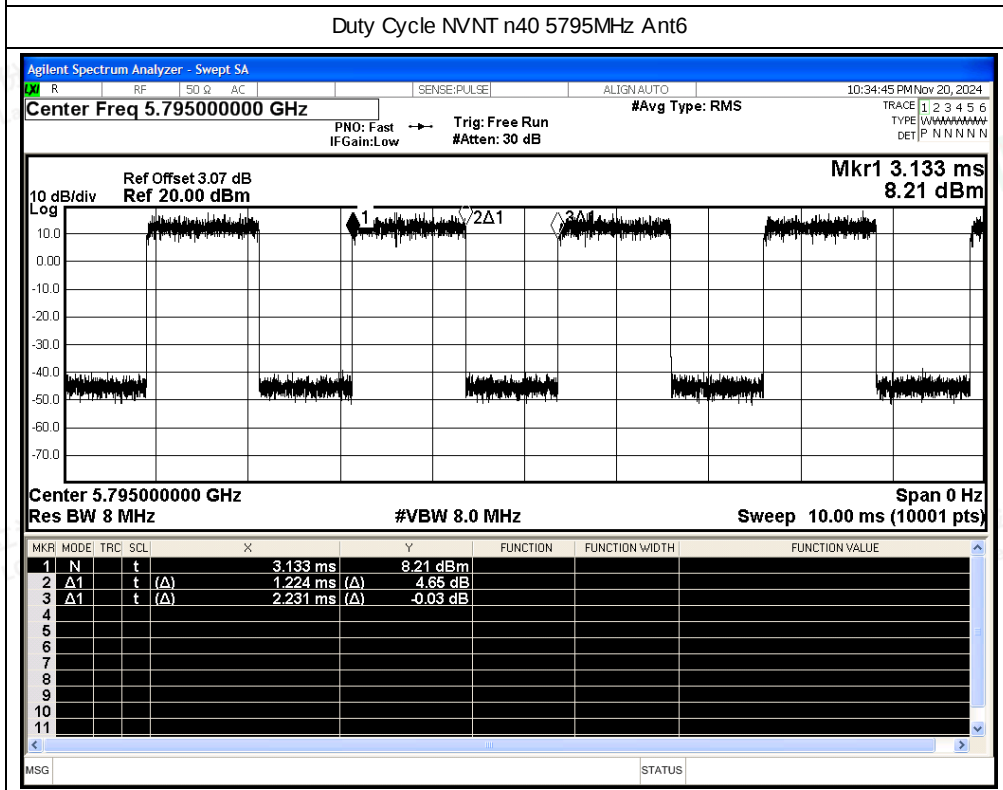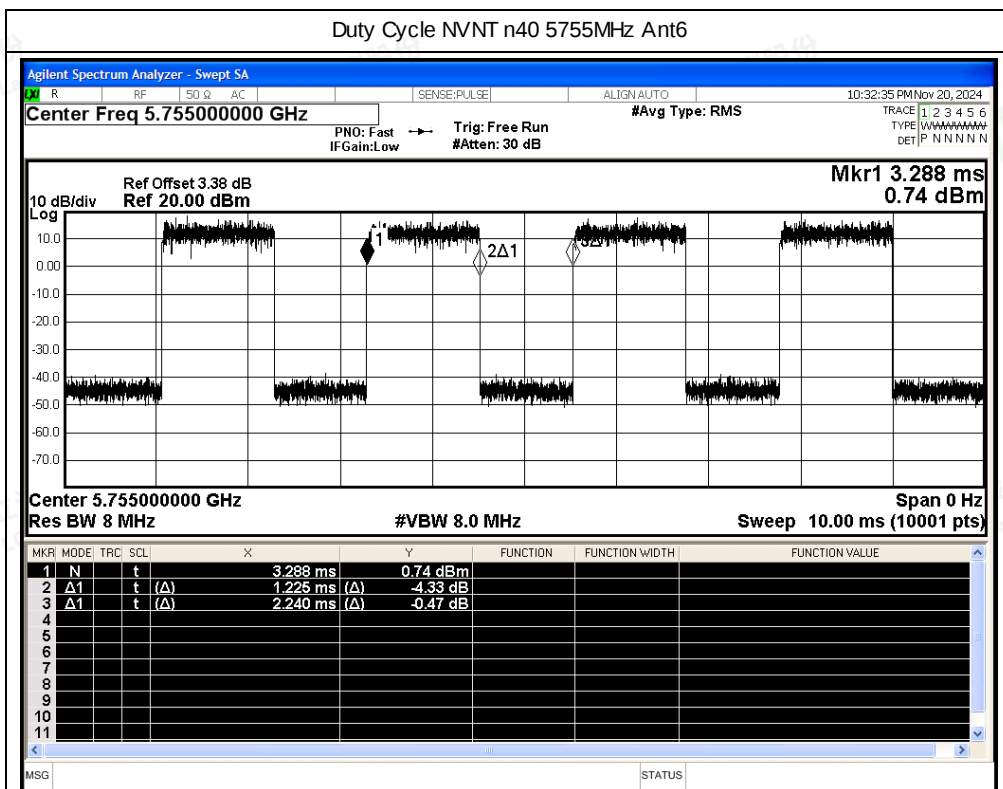

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5745MHz Ant6

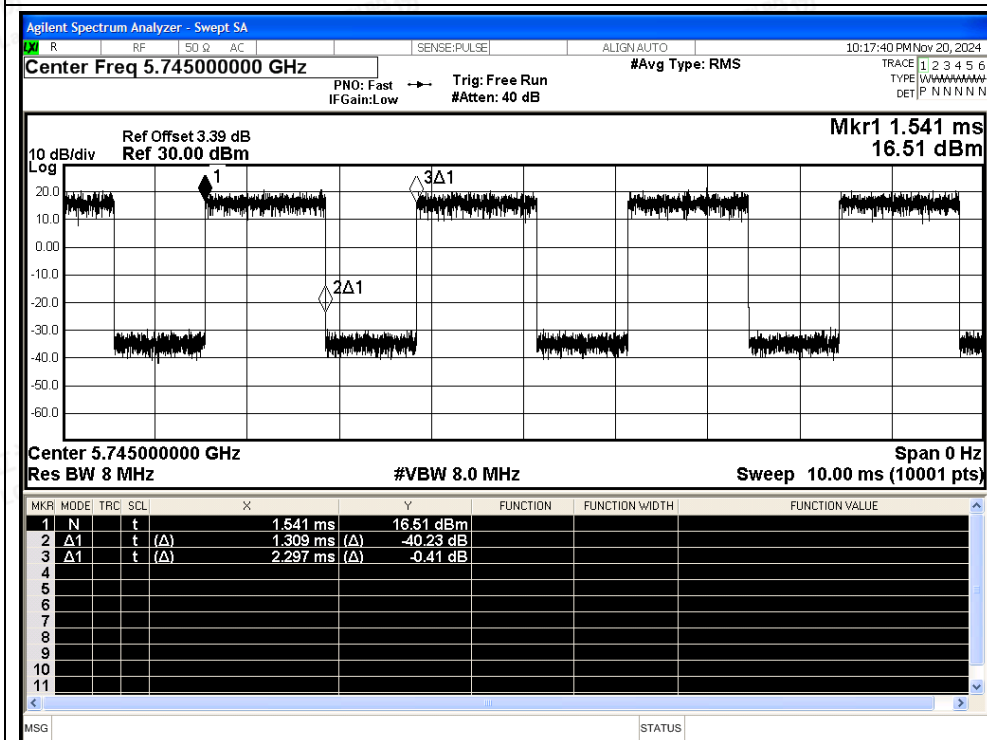

## Duty Cycle NVNT ac20 5785MHz Ant6


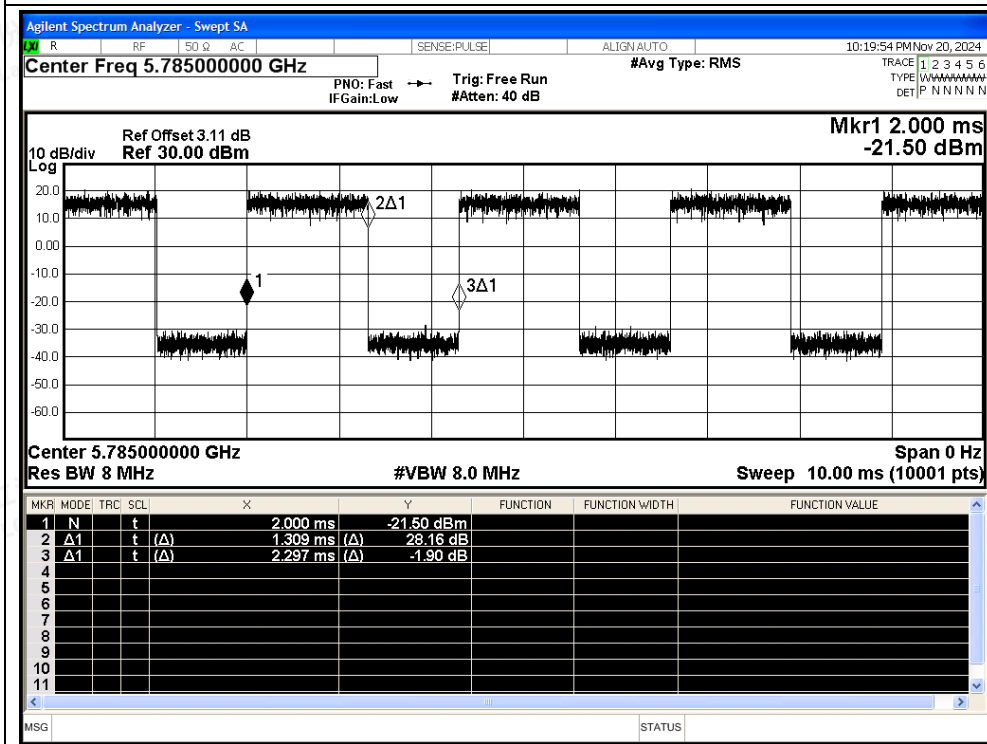


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

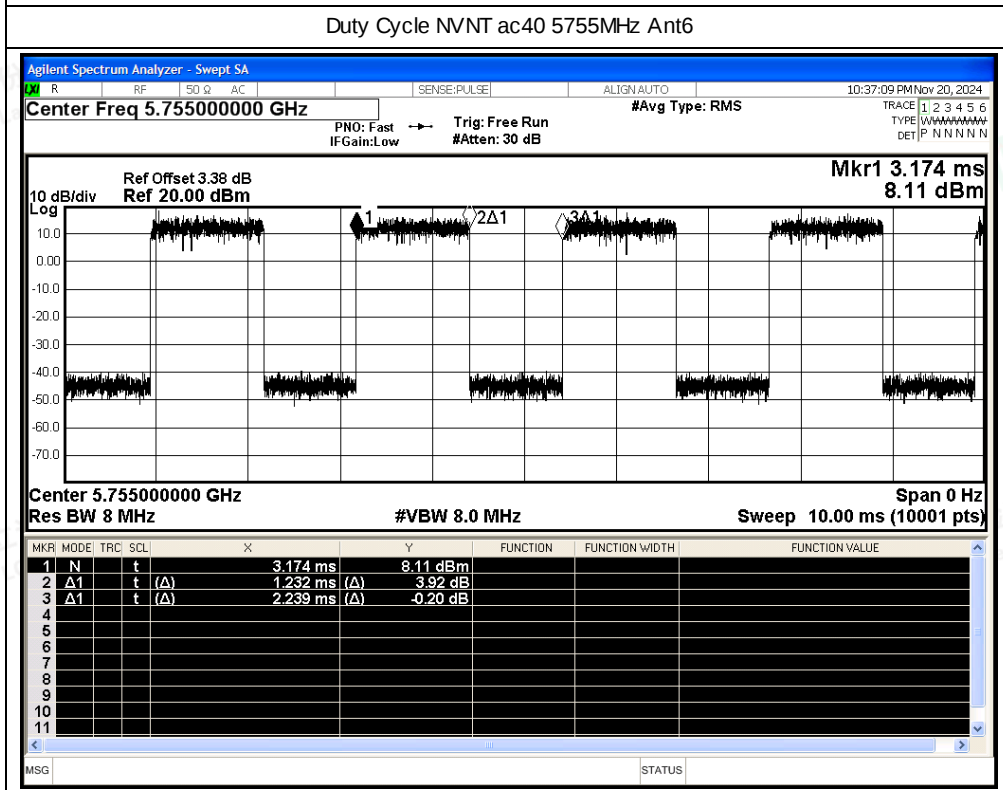
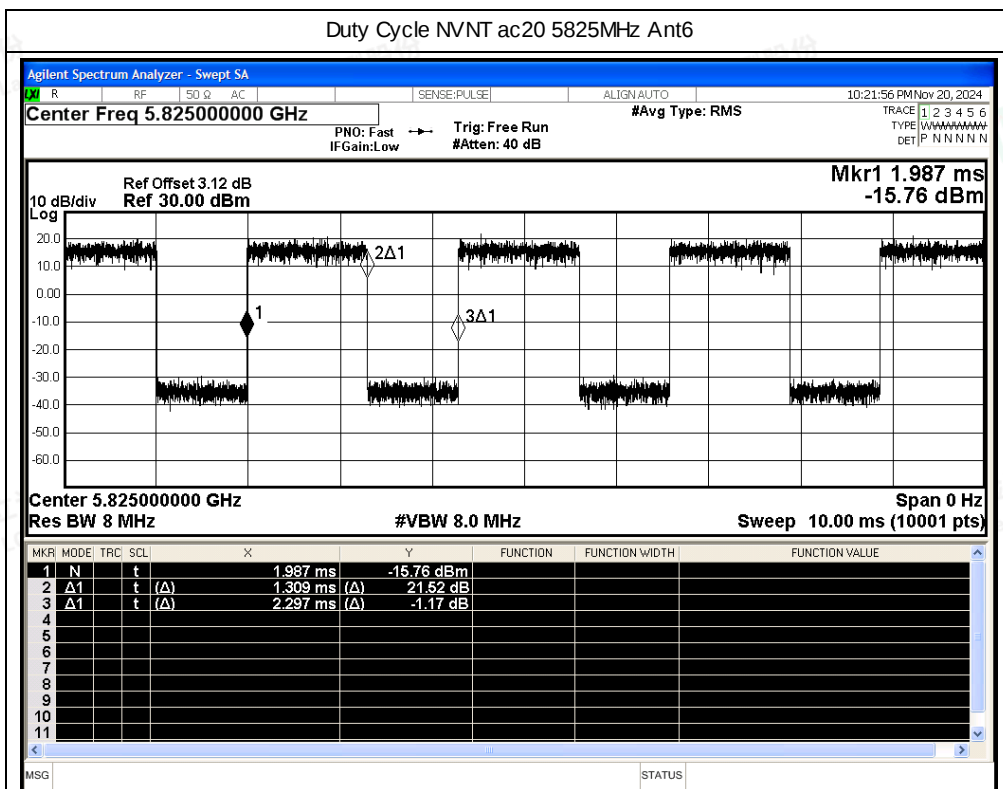


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

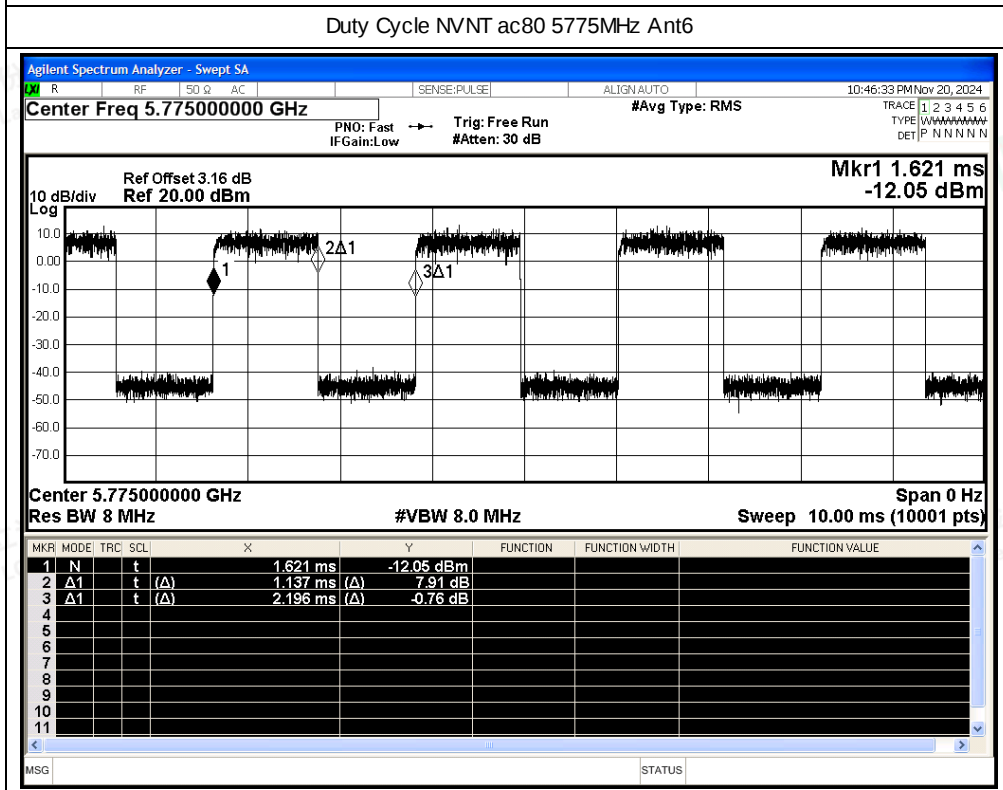
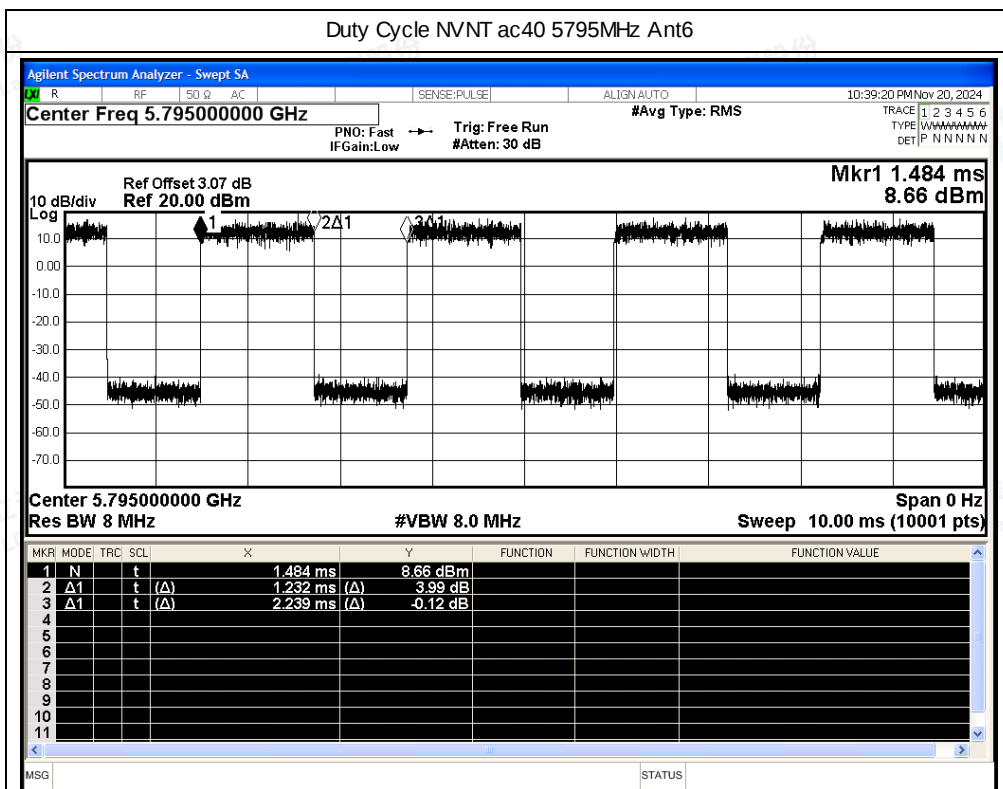


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

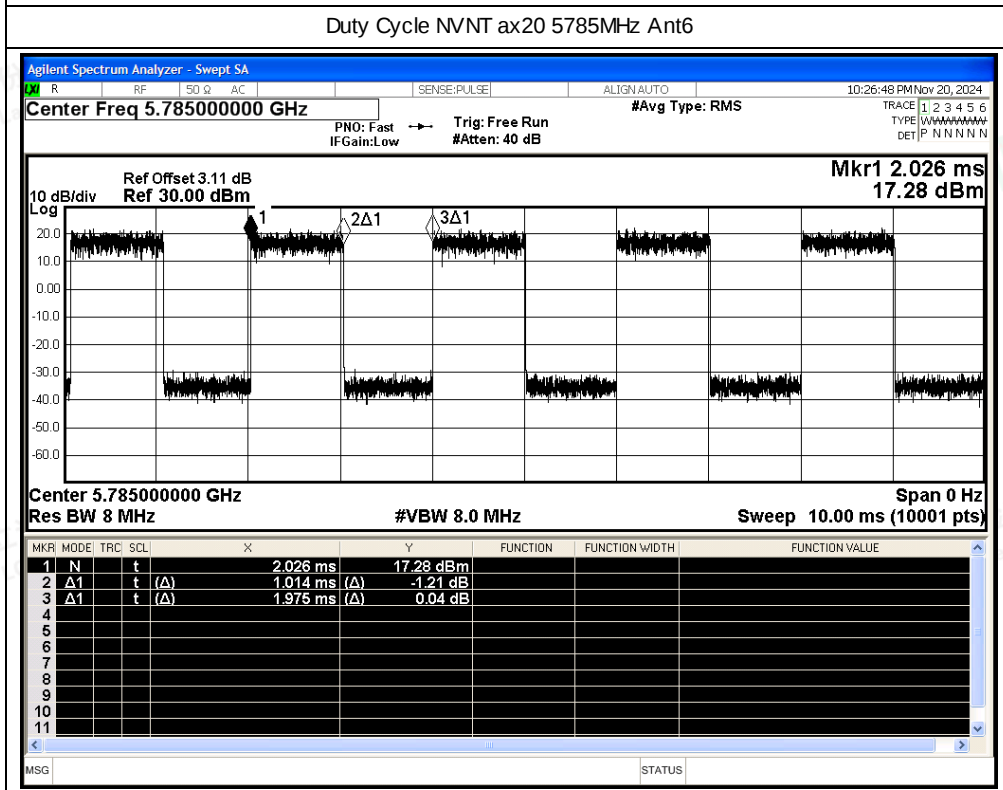
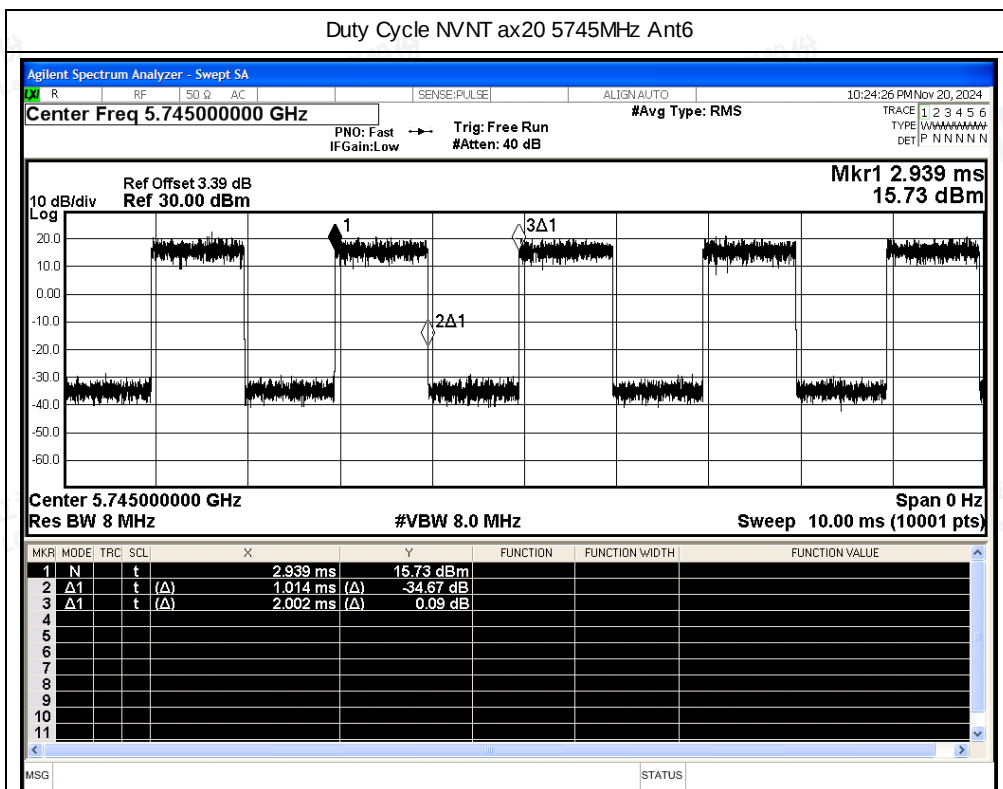


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

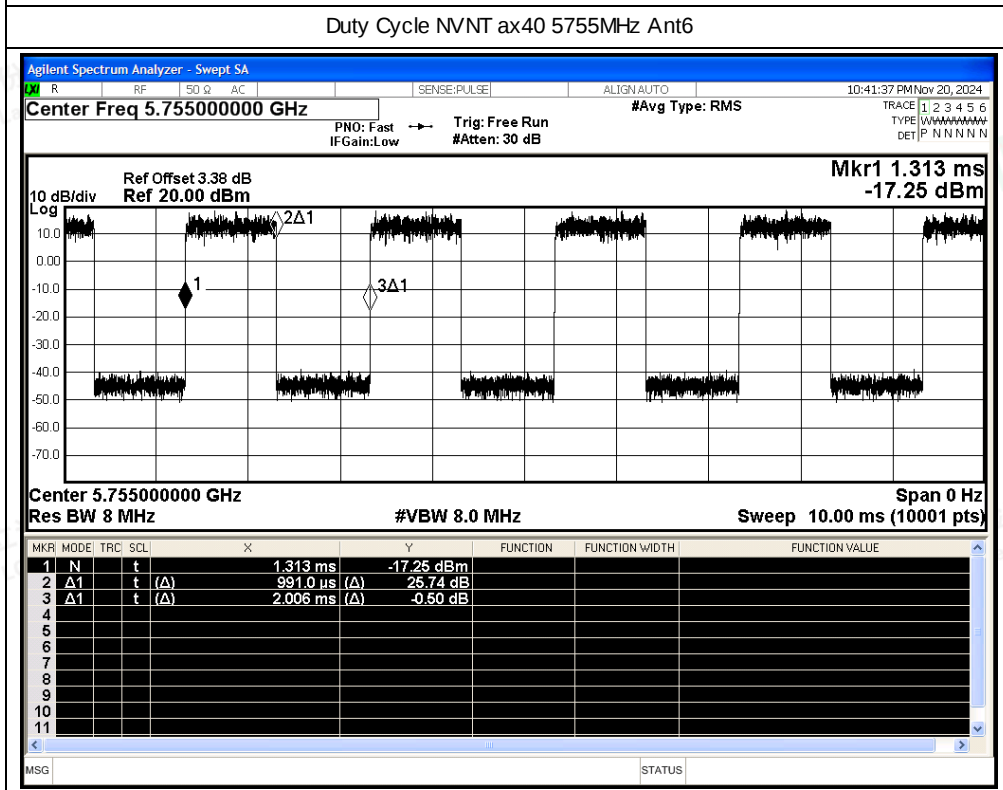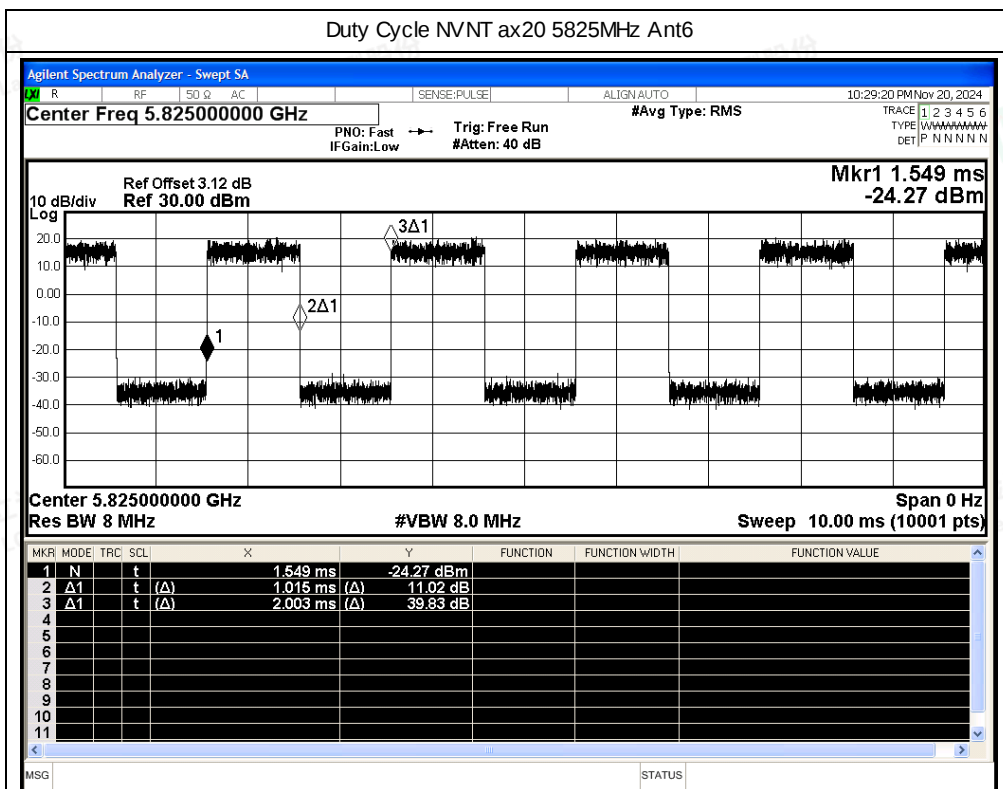

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5795MHz Ant6

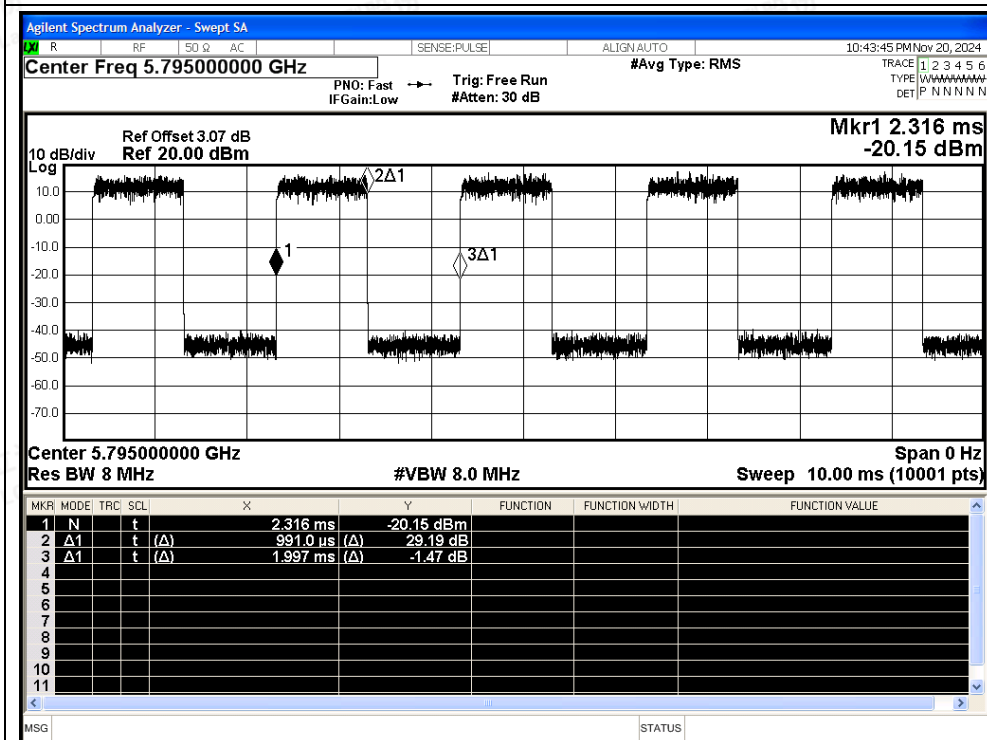

## Duty Cycle NVNT ax80 5775MHz Ant6

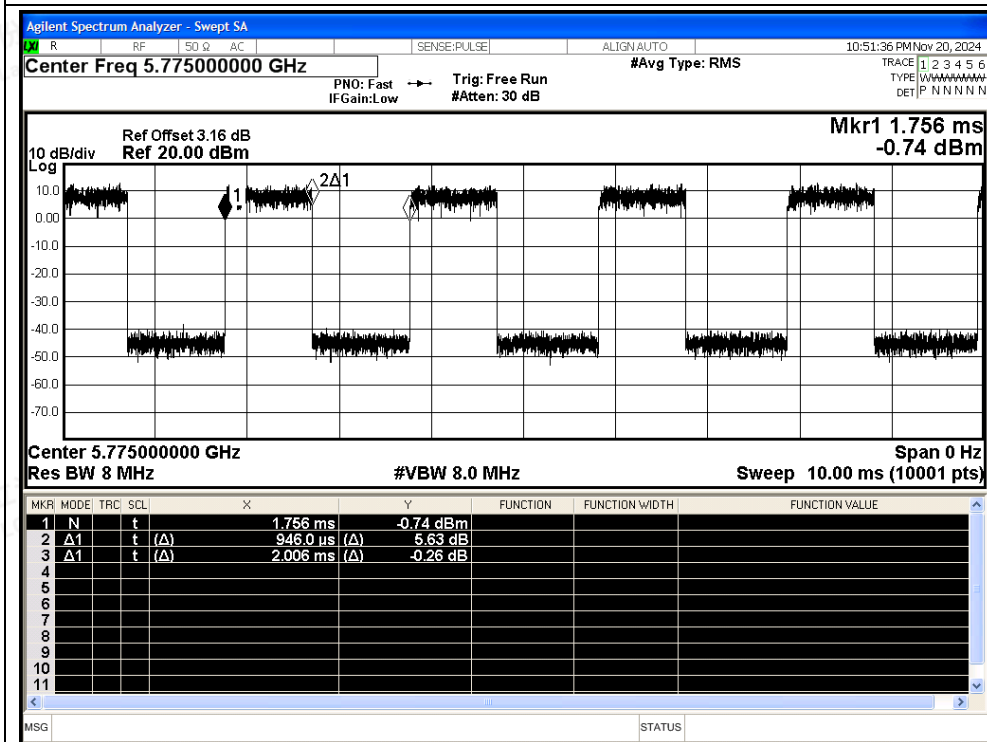

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant7    | 58.73          | 2.31                   | 0.72      |
| NVNT      | a    | 5785            | Ant7    | 58.46          | 2.33                   | 0.72      |
| NVNT      | a    | 5825            | Ant7    | 58.46          | 2.33                   | 0.72      |
| NVNT      | n20  | 5745            | Ant7    | 57.06          | 2.44                   | 0.77      |
| NVNT      | n20  | 5785            | Ant7    | 57.02          | 2.44                   | 0.77      |
| NVNT      | n20  | 5825            | Ant7    | 57.02          | 2.44                   | 0.77      |
| NVNT      | n40  | 5755            | Ant7    | 54.91          | 2.6                    | 0.82      |
| NVNT      | n40  | 5795            | Ant7    | 54.86          | 2.61                   | 0.82      |
| NVNT      | ac20 | 5745            | Ant7    | 55.21          | 2.58                   | 0.76      |
| NVNT      | ac20 | 5785            | Ant7    | 56.99          | 2.44                   | 0.76      |
| NVNT      | ac20 | 5825            | Ant7    | 56.94          | 2.45                   | 0.76      |
| NVNT      | ac40 | 5755            | Ant7    | 53.56          | 2.71                   | 0.81      |
| NVNT      | ac40 | 5795            | Ant7    | 56.2           | 2.5                    | 0.81      |
| NVNT      | ac80 | 5775            | Ant7    | 51.73          | 2.86                   | 0.88      |
| NVNT      | ax20 | 5745            | Ant7    | 50.65          | 2.95                   | 0.99      |
| NVNT      | ax20 | 5785            | Ant7    | 50.65          | 2.95                   | 0.99      |
| NVNT      | ax20 | 5825            | Ant7    | 50.7           | 2.95                   | 0.99      |
| NVNT      | ax40 | 5755            | Ant7    | 49.85          | 3.02                   | 1.01      |
| NVNT      | ax40 | 5795            | Ant7    | 48.96          | 3.1                    | 1.01      |
| NVNT      | ax80 | 5775            | Ant7    | 46.95          | 3.28                   | 1.06      |






## Test Graphs

## Duty Cycle NVNT a 5745MHz Ant7

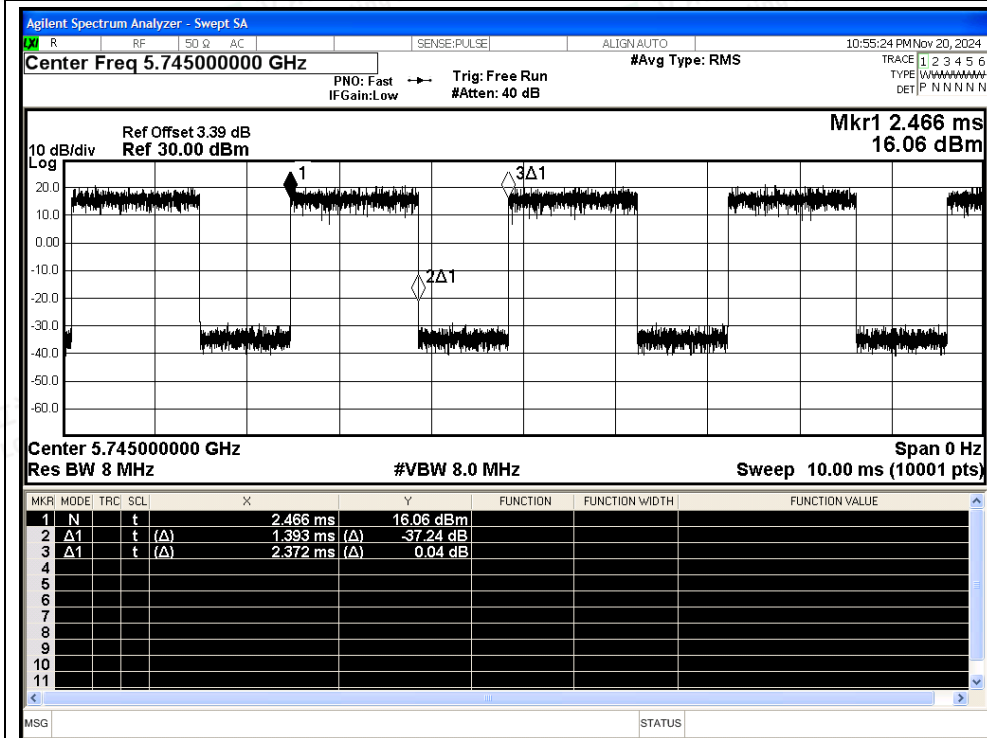

## Duty Cycle NVNT a 5785MHz Ant7


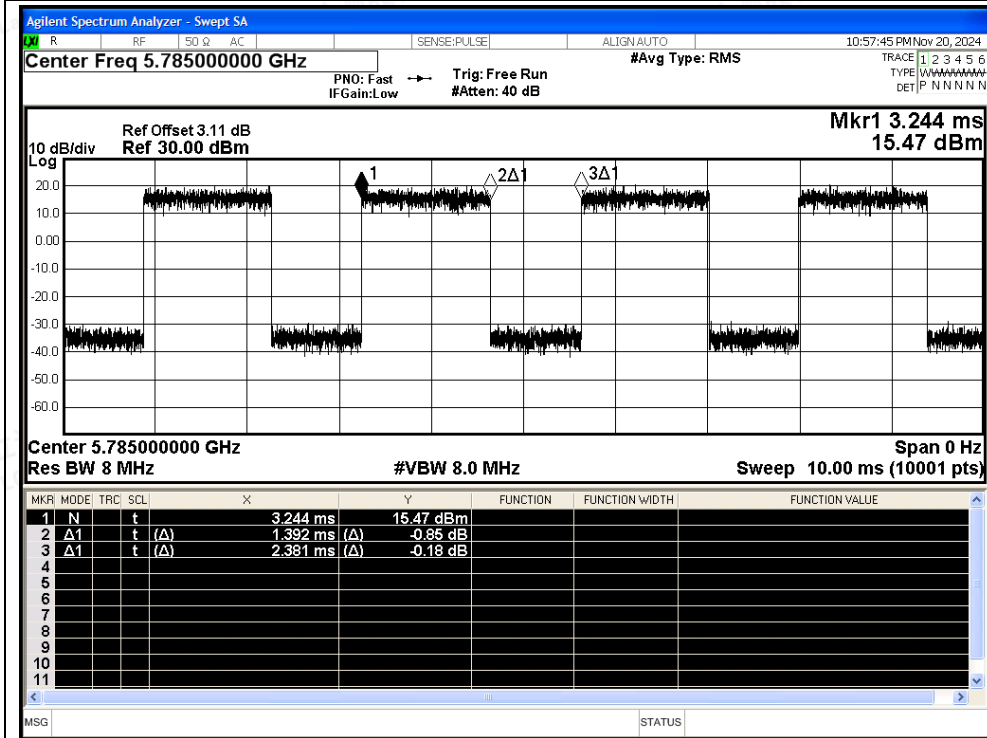


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

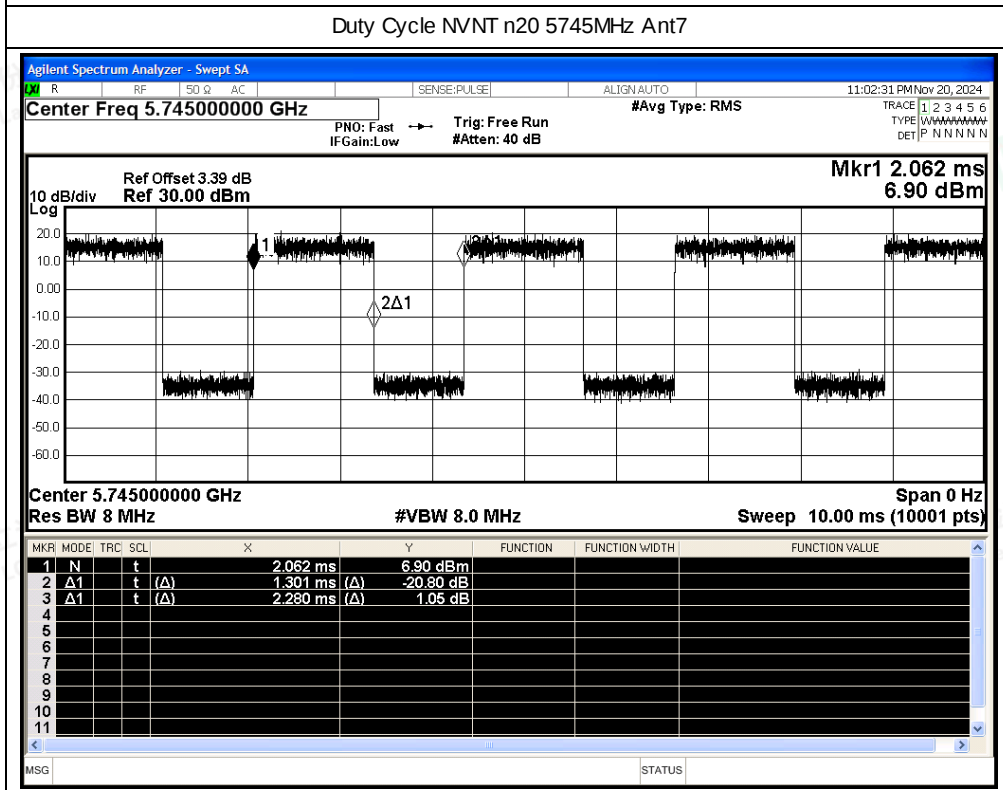
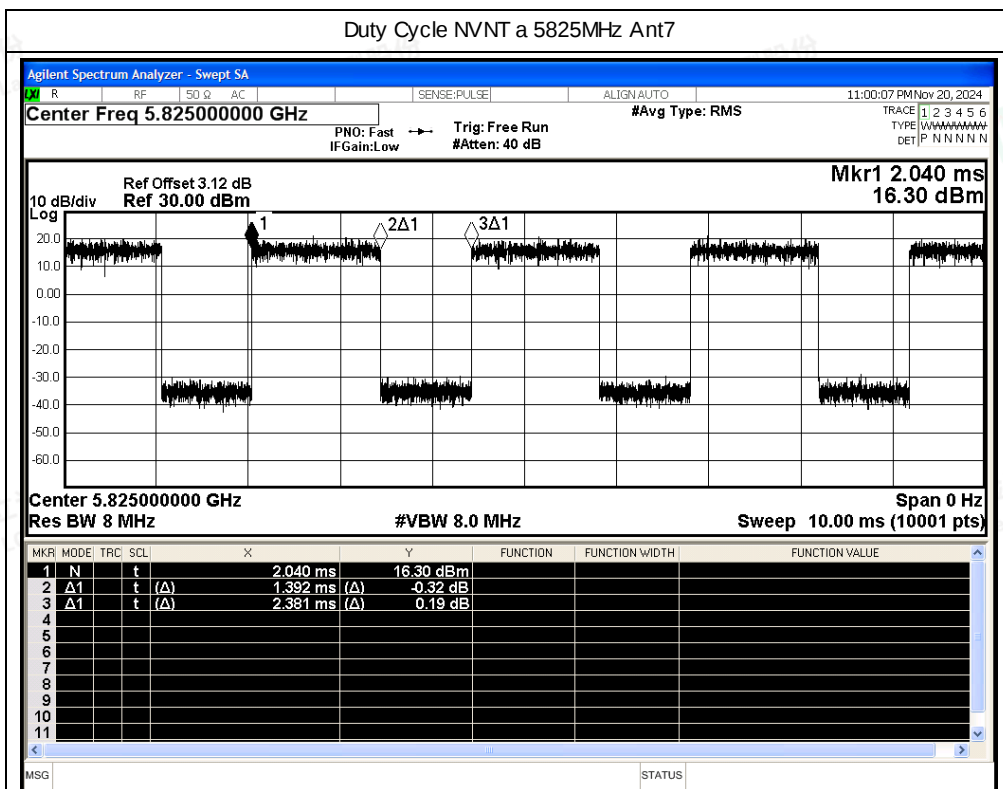


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

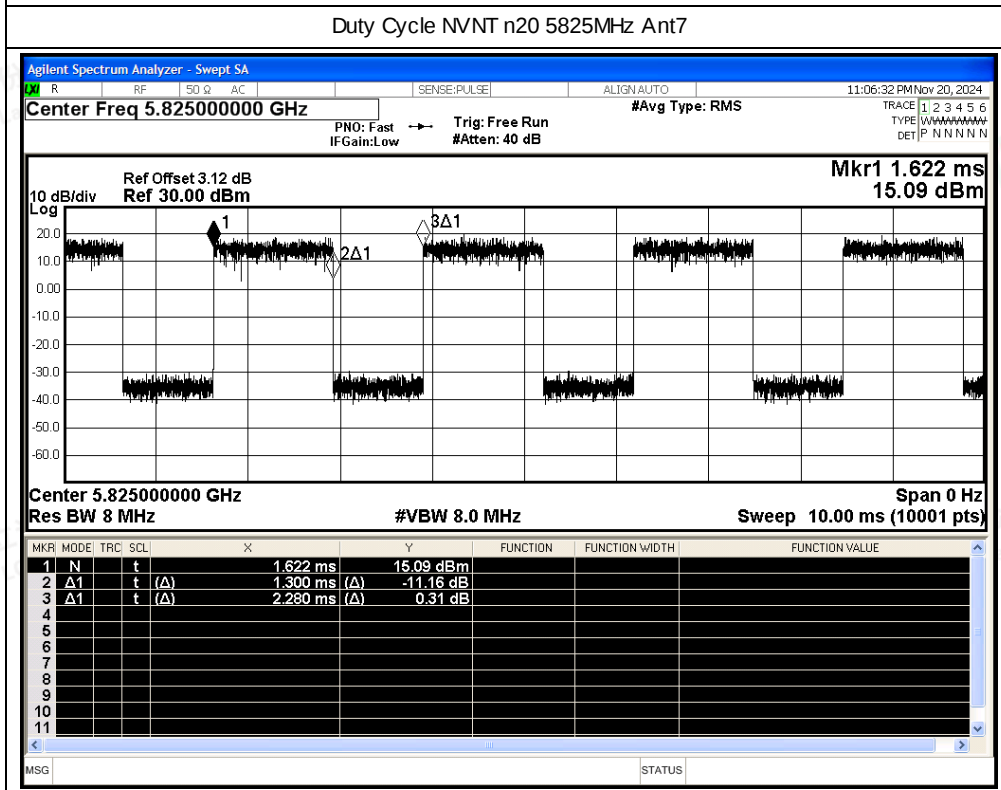
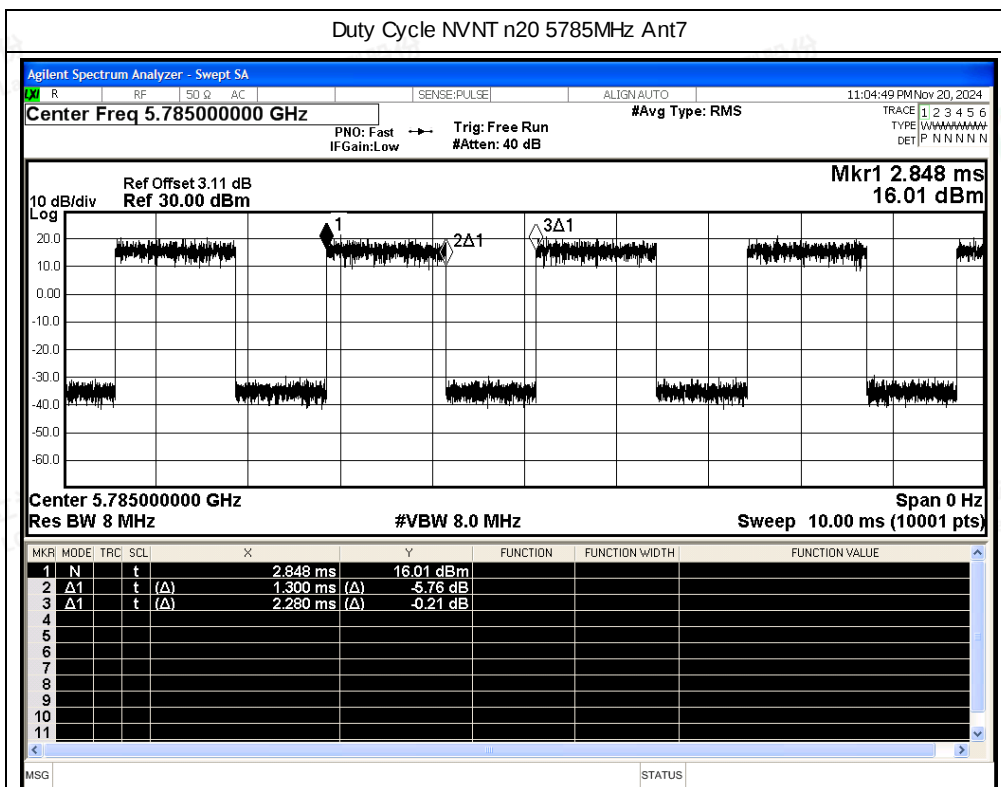


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

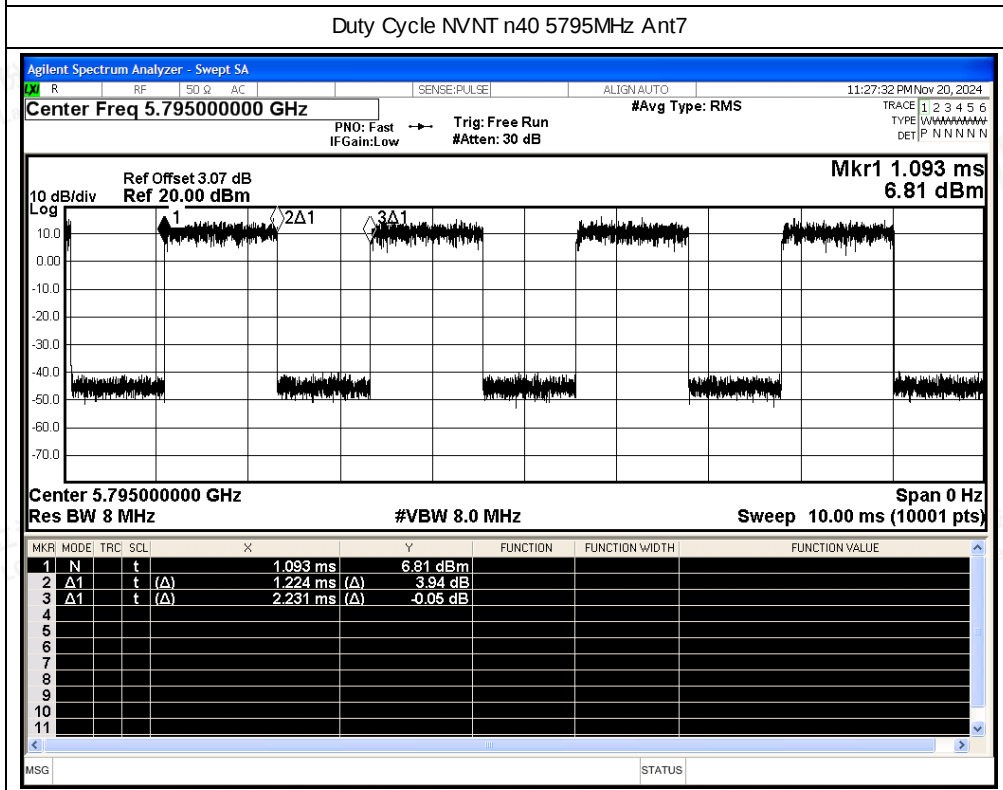
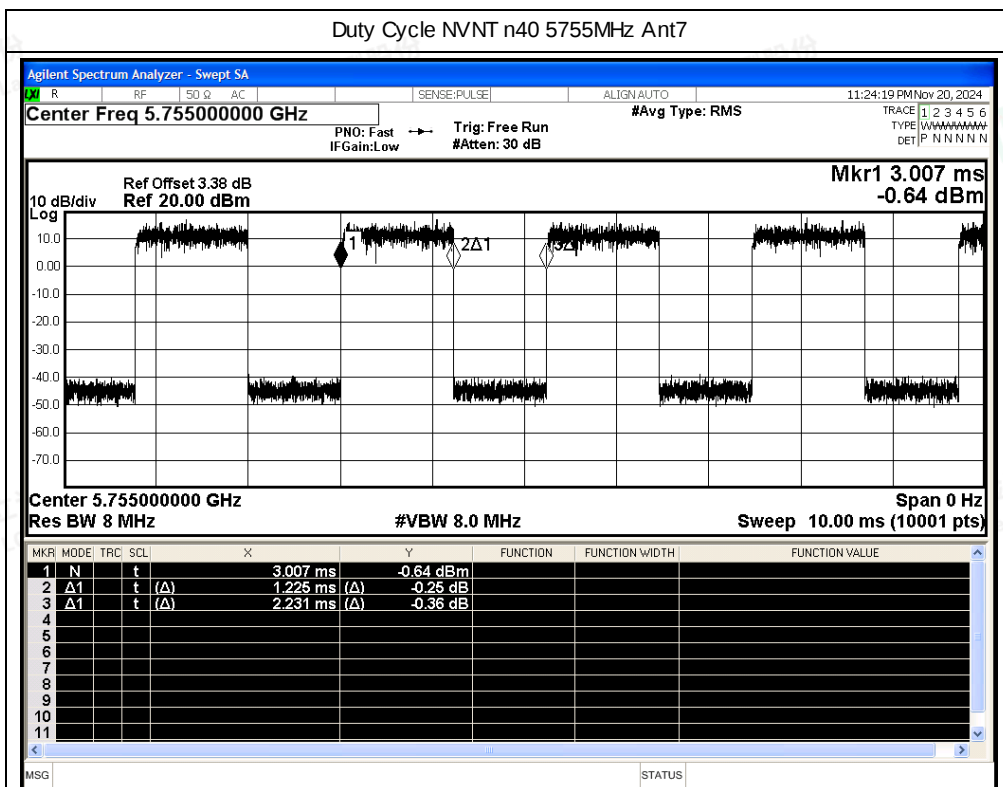


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

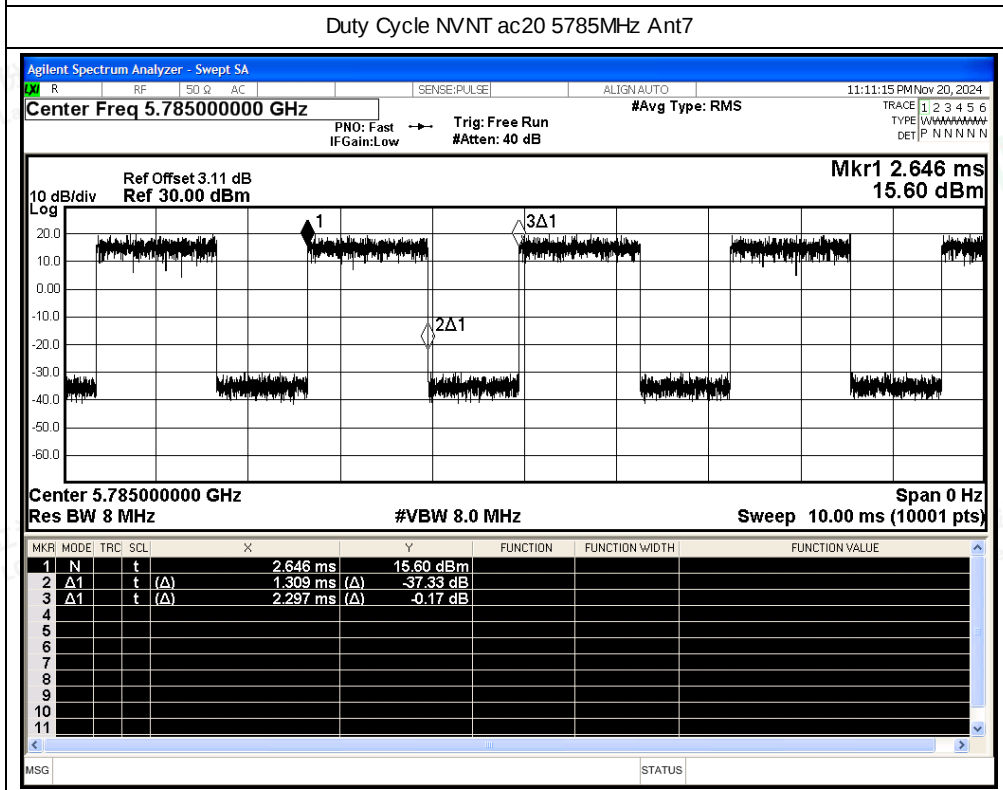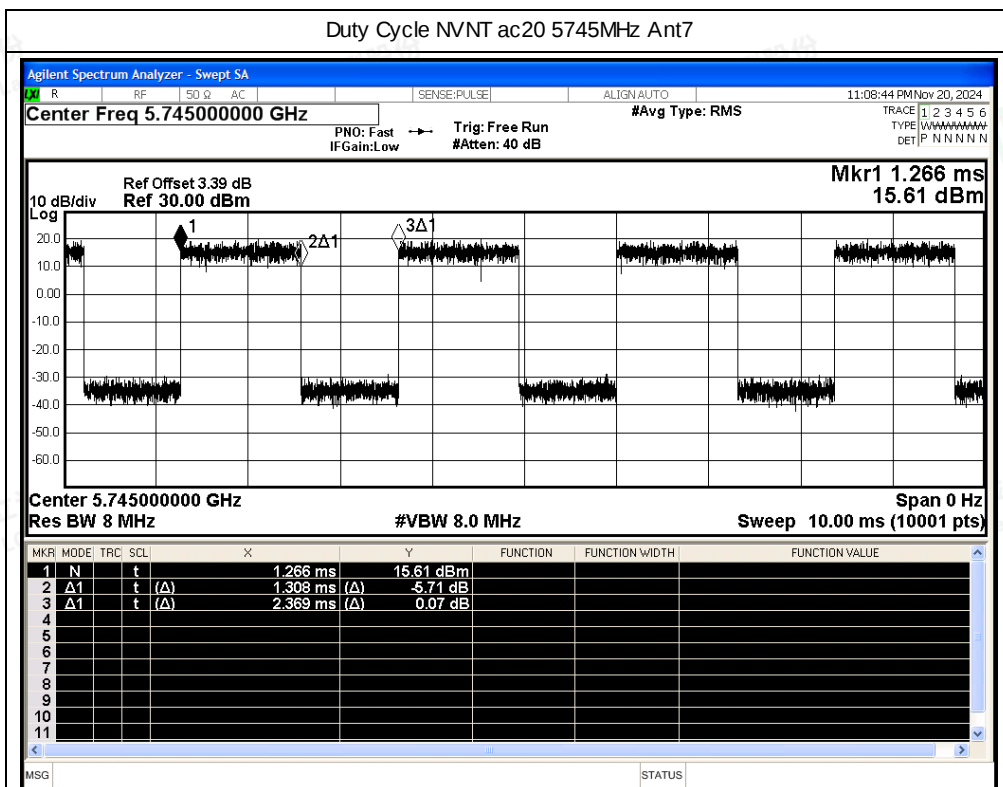

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5825MHz Ant7

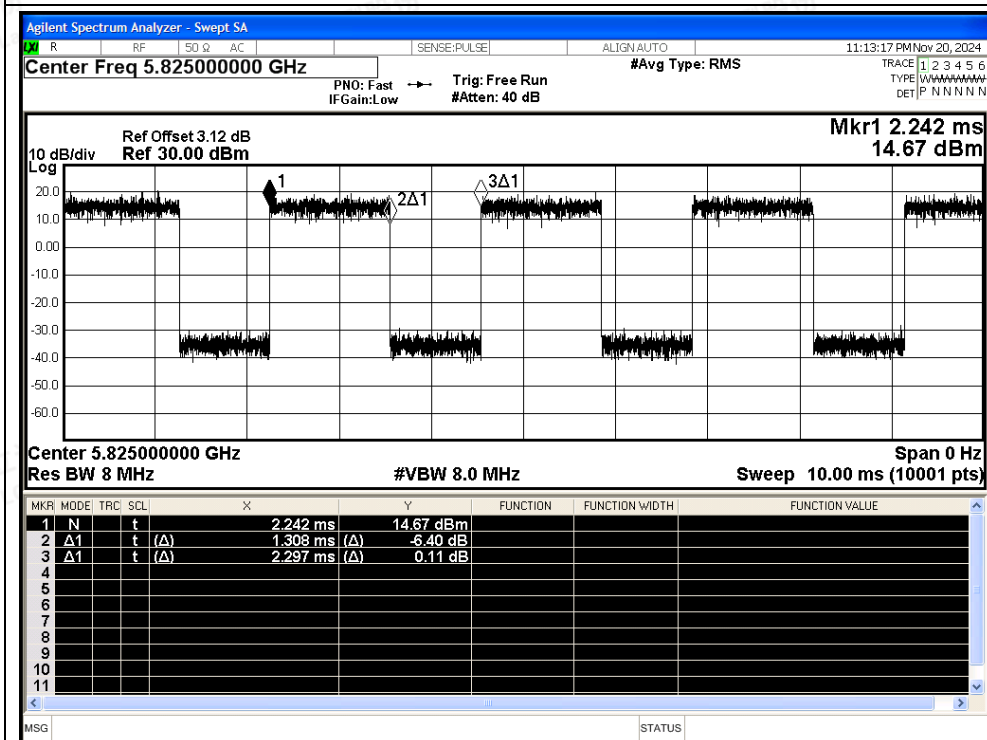

## Duty Cycle NVNT ac40 5755MHz Ant7


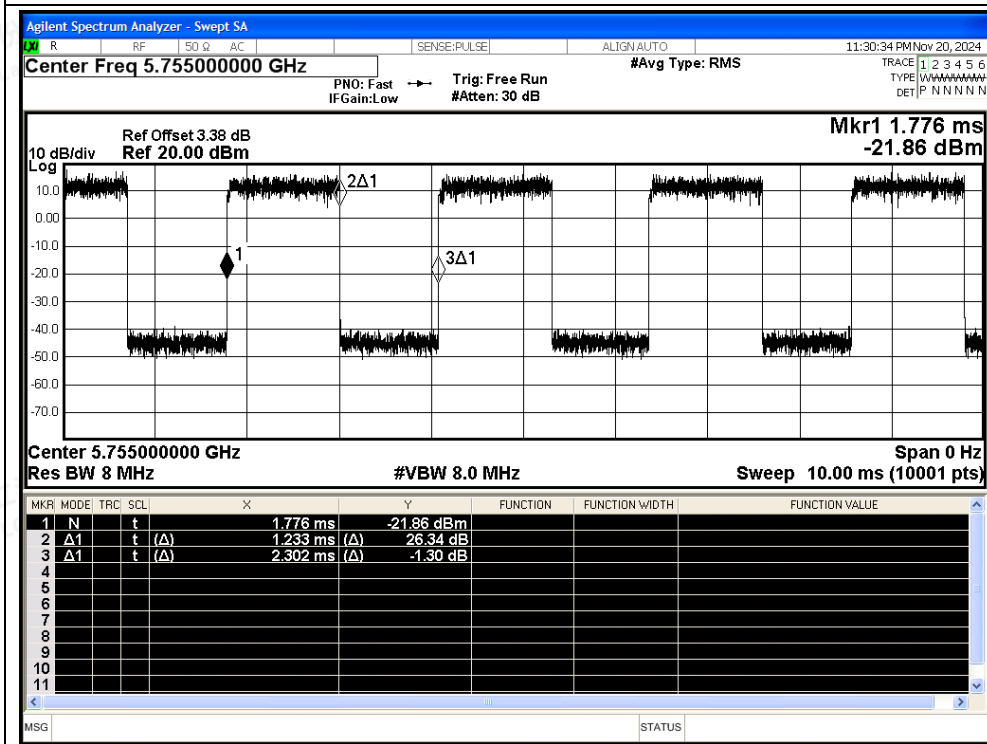


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

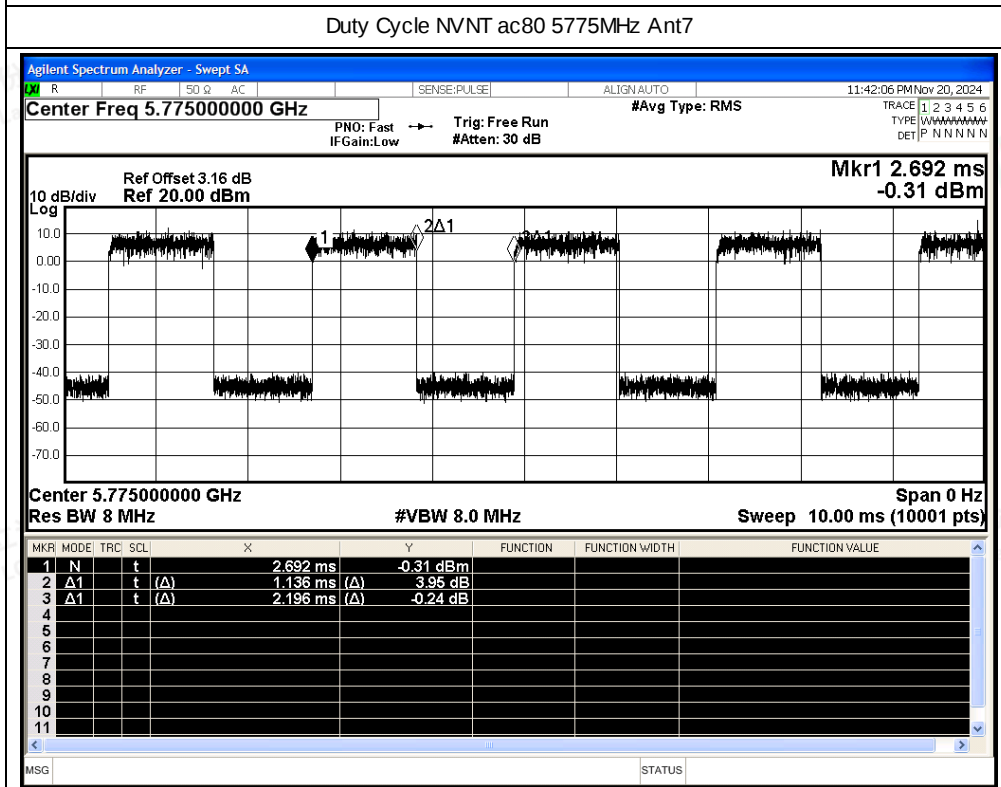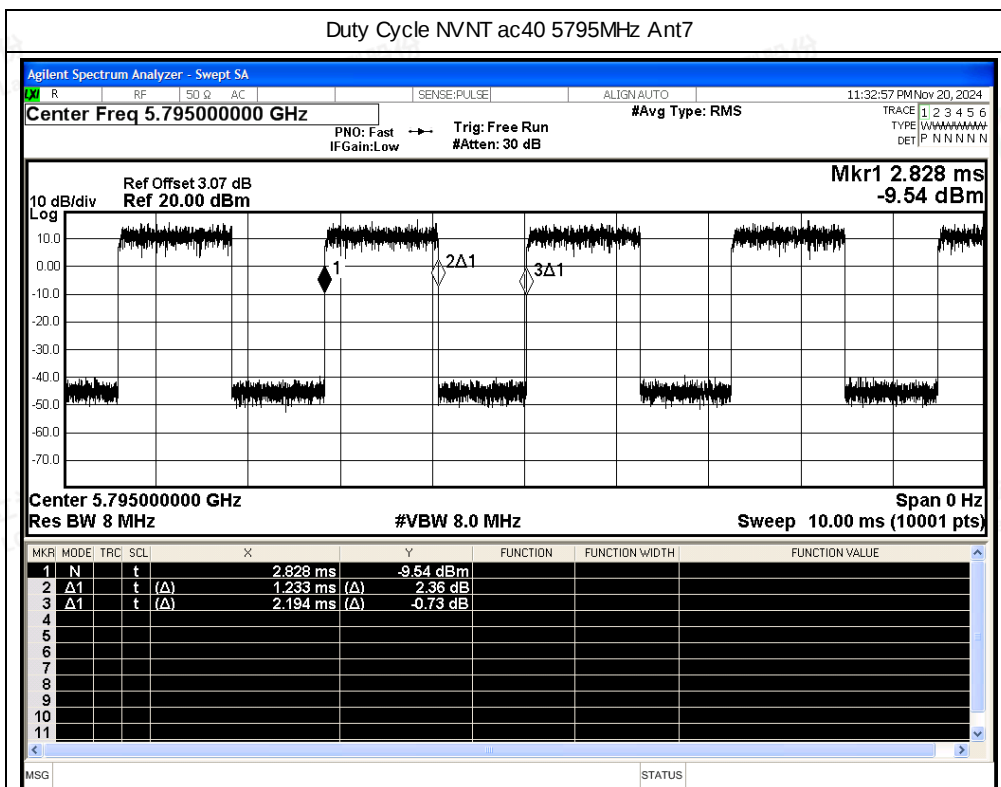

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5745MHz Ant7

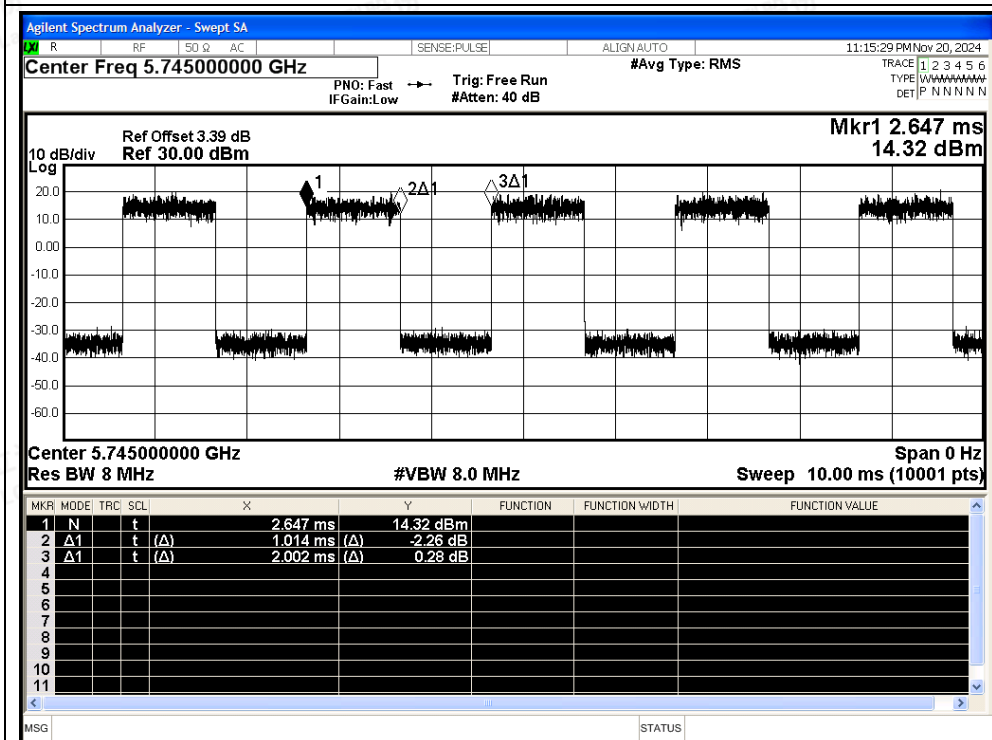

## Duty Cycle NVNT ax20 5785MHz Ant7

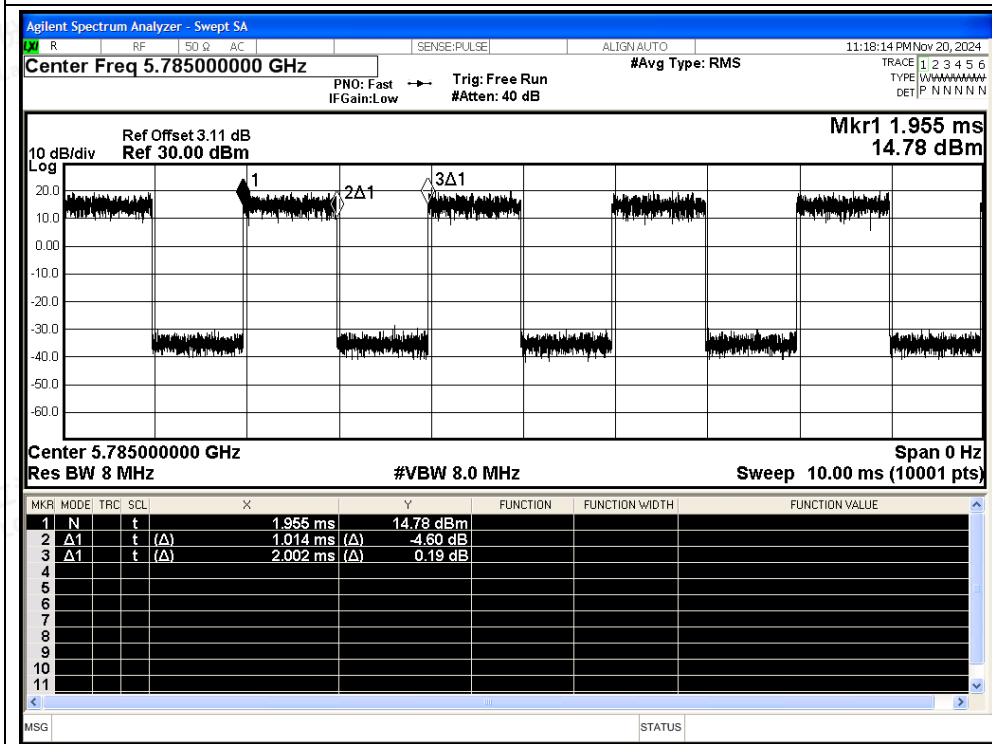

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5825MHz Ant7

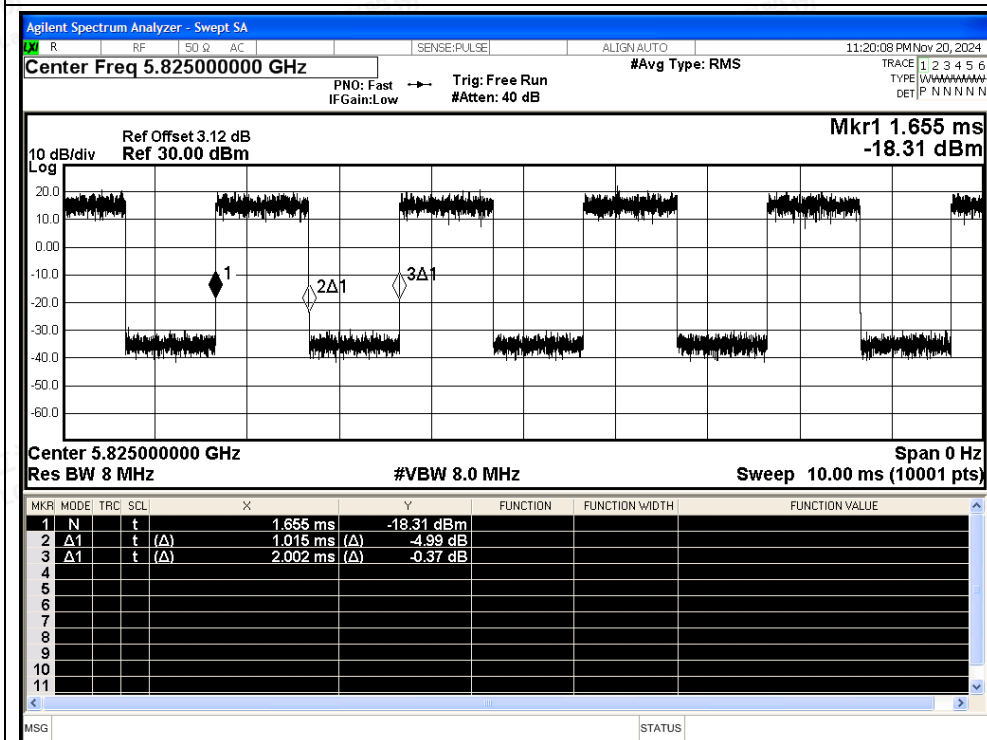

## Duty Cycle NVNT ax40 5755MHz Ant7

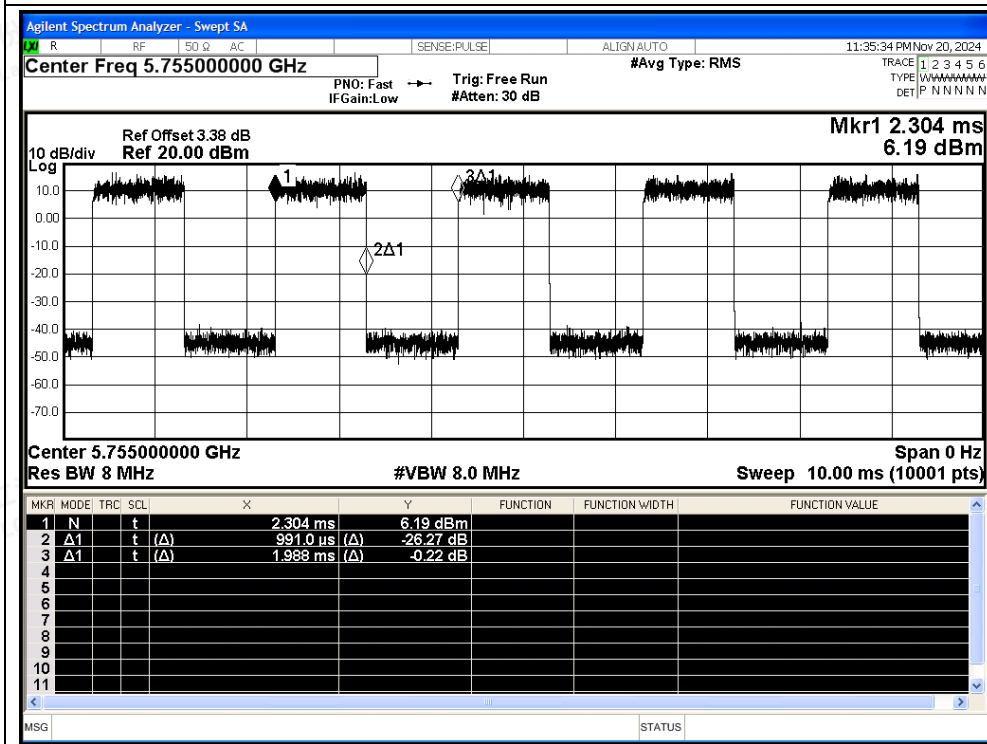

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5795MHz Ant7

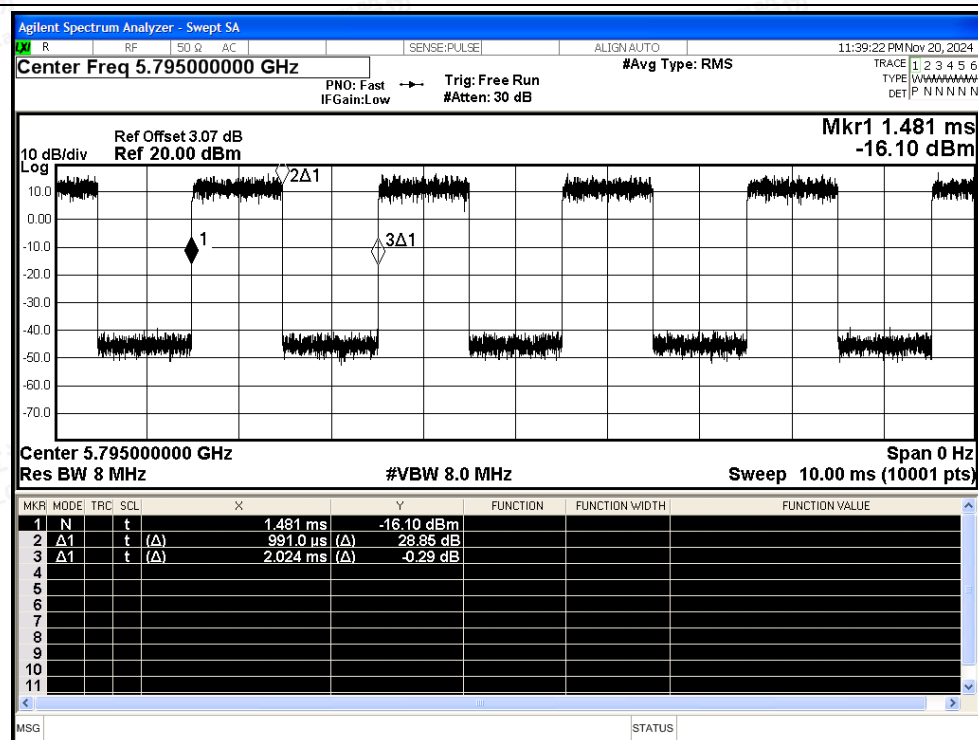

## Duty Cycle NVNT ax80 5775MHz Ant7

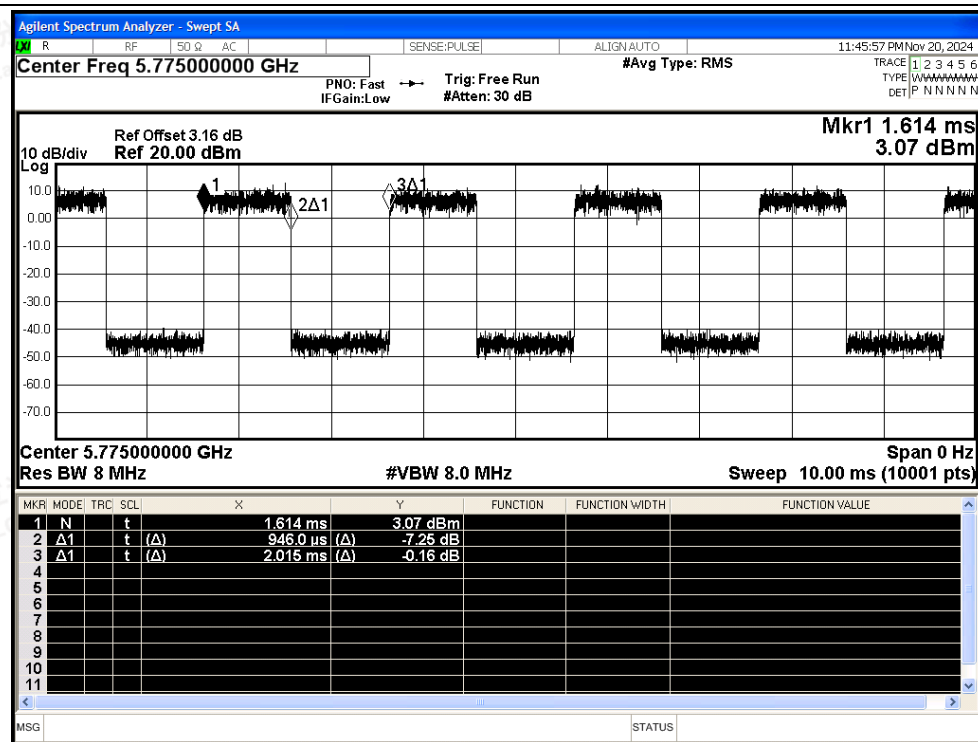

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity