



|      |      |      |      |      |        |      |      |        |         |      |      |
|------|------|------|------|------|--------|------|------|--------|---------|------|------|
| NVNT | n40  | 5755 | Ant2 | 5725 | -27.83 | 2.93 | -    | -24.9  | Peak    | 27   | Pass |
| NVNT | n40  | 5755 | Ant2 | 5725 | -40.49 | 2.93 | 0.24 | -41.01 | Average | 27   | Pass |
| NVNT | n40  | 5795 | Ant2 | 5850 | -46.68 | 2.93 | -    | -43.75 | Peak    | 27   | Pass |
| NVNT | n40  | 5795 | Ant2 | 5850 | -55.03 | 2.93 | 0.24 | -55.55 | Average | 27   | Pass |
| NVNT | n40  | 5795 | Ant2 | 5855 | -49.16 | 2.93 | -    | -46.23 | Peak    | 15.6 | Pass |
| NVNT | n40  | 5795 | Ant2 | 5855 | -55.69 | 2.93 | 0.24 | -56.21 | Average | 15.6 | Pass |
| NVNT | n40  | 5795 | Ant2 | 5875 | -49.6  | 2.93 | -    | -46.67 | Peak    | 10   | Pass |
| NVNT | n40  | 5795 | Ant2 | 5875 | -57.53 | 2.93 | 0.24 | -58.05 | Average | 10   | Pass |
| NVNT | n40  | 5795 | Ant2 | 5925 | -48.91 | 2.93 | -    | -45.98 | Peak    | -27  | Pass |
| NVNT | n40  | 5795 | Ant2 | 5925 | -57.14 | 2.93 | 0.24 | -57.66 | Average | -27  | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5650 | -49.12 | 2.93 | -    | -46.19 | Peak    | -27  | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5650 | -56.75 | 2.93 | 0.12 | -57.51 | Average | -27  | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5700 | -47.62 | 2.93 | -    | -44.69 | Peak    | 10   | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5700 | -55    | 2.93 | 0.12 | -55.76 | Average | 10   | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5720 | -32.69 | 2.93 | -    | -29.76 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5720 | -44.34 | 2.93 | 0.12 | -45.1  | Average | 15.6 | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5725 | -17.31 | 2.93 | -    | -14.38 | Peak    | 27   | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5725 | -42.16 | 2.93 | 0.12 | -42.92 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5850 | -33.9  | 2.93 | -    | -30.97 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5850 | -48.56 | 2.93 | 0.12 | -49.32 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5855 | -42.43 | 2.93 | -    | -39.5  | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5855 | -51.76 | 2.93 | 0.12 | -52.52 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5875 | -47.3  | 2.93 | -    | -44.37 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5875 | -56.32 | 2.93 | 0.12 | -57.08 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5925 | -48.54 | 2.93 | -    | -45.61 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5925 | -56.24 | 2.93 | 0.12 | -57    | Average | -27  | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5650 | -48.18 | 2.93 | -    | -45.25 | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5650 | -56.71 | 2.93 | 0.24 | -57.23 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5700 | -45.5  | 2.93 | -    | -42.57 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5700 | -53.5  | 2.93 | 0.24 | -54.02 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5720 | -30.4  | 2.93 | -    | -27.47 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5720 | -43.35 | 2.93 | 0.24 | -43.87 | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5725 | -25.9  | 2.93 | -    | -22.97 | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5725 | -40    | 2.93 | 0.24 | -40.52 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5850 | -47.94 | 2.93 | -    | -45.01 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5850 | -54.63 | 2.93 | 0.23 | -55.17 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5855 | -46.68 | 2.93 | -    | -43.75 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5855 | -56.64 | 2.93 | 0.23 | -57.18 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5875 | -48.31 | 2.93 | -    | -45.38 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5875 | -57.7  | 2.93 | 0.23 | -58.24 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5925 | -47.92 | 2.93 | -    | -44.99 | Peak    | -27  | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5925 | -57.67 | 2.93 | 0.23 | -58.21 | Average | -27  | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |      |      |        |         |      |      |
|------|------|------|------|------|--------|------|------|--------|---------|------|------|
| NVNT | ac80 | 5775 | Ant2 | 5850 | -35.8  | 2.93 | -    | -32.87 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5850 | -48.56 | 2.93 | 0.25 | -49.06 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5855 | -41.55 | 2.93 | -    | -38.62 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5855 | -48.85 | 2.93 | 0.25 | -49.35 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5875 | -44    | 2.93 | -    | -41.07 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5875 | -53.45 | 2.93 | 0.25 | -53.95 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5925 | -49.16 | 2.93 | -    | -46.23 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5925 | -56.66 | 2.93 | 0.25 | -57.16 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5650 | -47.21 | 2.93 | -    | -44.28 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5650 | -55.9  | 2.93 | 0.25 | -56.4  | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5700 | -44.24 | 2.93 | -    | -41.31 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5700 | -52.12 | 2.93 | 0.25 | -52.62 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5720 | -35.77 | 2.93 | -    | -32.84 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5720 | -47.45 | 2.93 | 0.25 | -47.95 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5725 | -27.34 | 2.93 | -    | -24.41 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5725 | -43.77 | 2.93 | 0.25 | -44.27 | Average | 27   | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5650 | -46.58 | 2.93 | -    | -43.65 | Peak    | -27  | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5650 | -57.15 | 2.93 | 0.12 | -57.91 | Average | -27  | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5700 | -43.88 | 2.93 | -    | -40.95 | Peak    | 10   | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5700 | -54.4  | 2.93 | 0.12 | -55.16 | Average | 10   | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5720 | -31.75 | 2.93 | -    | -28.82 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5720 | -46.29 | 2.93 | 0.12 | -47.05 | Average | 15.6 | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5725 | -23.56 | 2.93 | -    | -20.63 | Peak    | 27   | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5725 | -37.04 | 2.93 | 0.12 | -37.8  | Average | 27   | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5850 | -35.41 | 2.93 | -    | -32.48 | Peak    | 27   | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5850 | -48.21 | 2.93 | 0.12 | -48.97 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5855 | -40.43 | 2.93 | -    | -37.5  | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5855 | -52.67 | 2.93 | 0.12 | -53.43 | Average | 15.6 | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5875 | -49.03 | 2.93 | -    | -46.1  | Peak    | 10   | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5875 | -55.7  | 2.93 | 0.12 | -56.46 | Average | 10   | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5925 | -48.43 | 2.93 | -    | -45.5  | Peak    | -27  | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5925 | -56.83 | 2.93 | 0.12 | -57.59 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5650 | -50.33 | 2.93 | -    | -47.4  | Peak    | -27  | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5650 | -57.23 | 2.93 | 0.24 | -57.75 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5700 | -44.13 | 2.93 | -    | -41.2  | Peak    | 10   | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5700 | -52.82 | 2.93 | 0.24 | -53.34 | Average | 10   | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5720 | -30.46 | 2.93 | -    | -27.53 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5720 | -43.31 | 2.93 | 0.24 | -43.83 | Average | 15.6 | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5725 | -29.74 | 2.93 | -    | -26.81 | Peak    | 27   | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5725 | -43.37 | 2.93 | 0.24 | -43.89 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5850 | -47.68 | 2.93 | -    | -44.75 | Peak    | 27   | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5850 | -54.89 | 2.93 | 0.24 | -55.41 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |      |      |        |         |      |      |
|------|------|------|------|------|--------|------|------|--------|---------|------|------|
| NVNT | ax40 | 5795 | Ant2 | 5855 | -46.5  | 2.93 | -    | -43.57 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5855 | -56.09 | 2.93 | 0.24 | -56.61 | Average | 15.6 | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5875 | -49.94 | 2.93 | -    | -47.01 | Peak    | 10   | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5875 | -57.32 | 2.93 | 0.24 | -57.84 | Average | 10   | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5925 | -49.92 | 2.93 | -    | -46.99 | Peak    | -27  | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5925 | -57.81 | 2.93 | 0.24 | -58.33 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5850 | -40.52 | 2.93 | -    | -37.59 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5850 | -47.88 | 2.93 | 0.25 | -48.38 | Average | 27   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5855 | -38.02 | 2.93 | -    | -35.09 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5855 | -48.89 | 2.93 | 0.25 | -49.39 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5875 | -44.14 | 2.93 | -    | -41.21 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5875 | -52.91 | 2.93 | 0.25 | -53.41 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5925 | -48.78 | 2.93 | -    | -45.85 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5925 | -56.98 | 2.93 | 0.25 | -57.48 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5650 | -47.75 | 2.93 | -    | -44.82 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5650 | -55.42 | 2.93 | 0.25 | -55.92 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5700 | -41.07 | 2.93 | -    | -38.14 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5700 | -52.05 | 2.93 | 0.25 | -52.55 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5720 | -35.28 | 2.93 | -    | -32.35 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5720 | -47.26 | 2.93 | 0.25 | -47.76 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5725 | -35.87 | 2.93 | -    | -32.94 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5725 | -44.95 | 2.93 | 0.25 | -45.45 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Restrict Band NVNT a 5745MHz Ant2 Peak

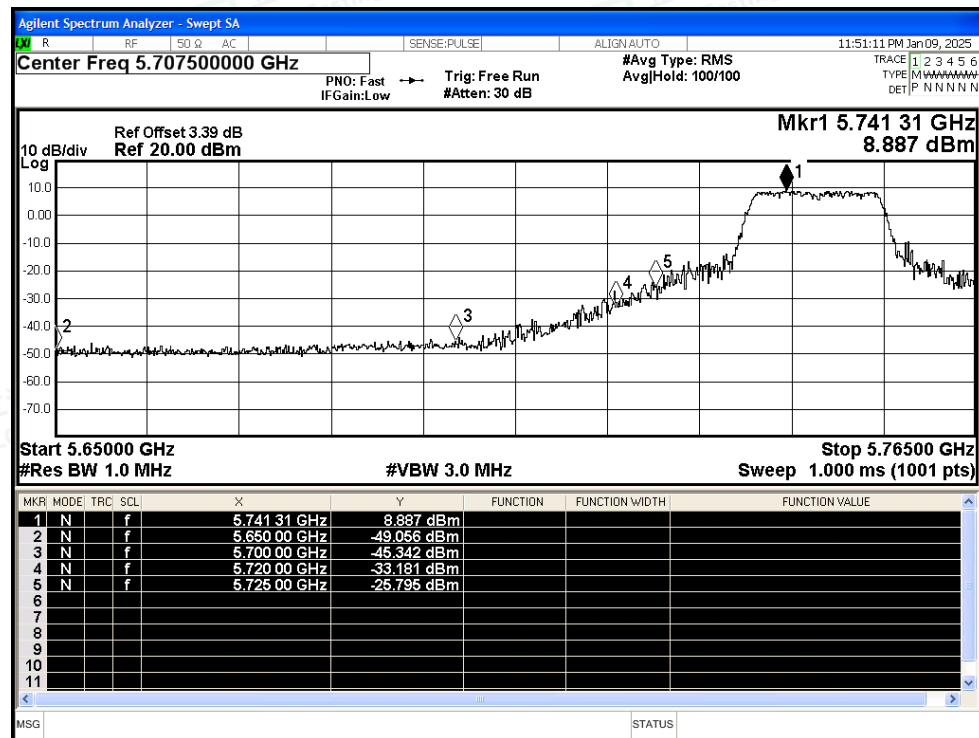

## Restrict Band NVNT a 5745MHz Ant2 Average

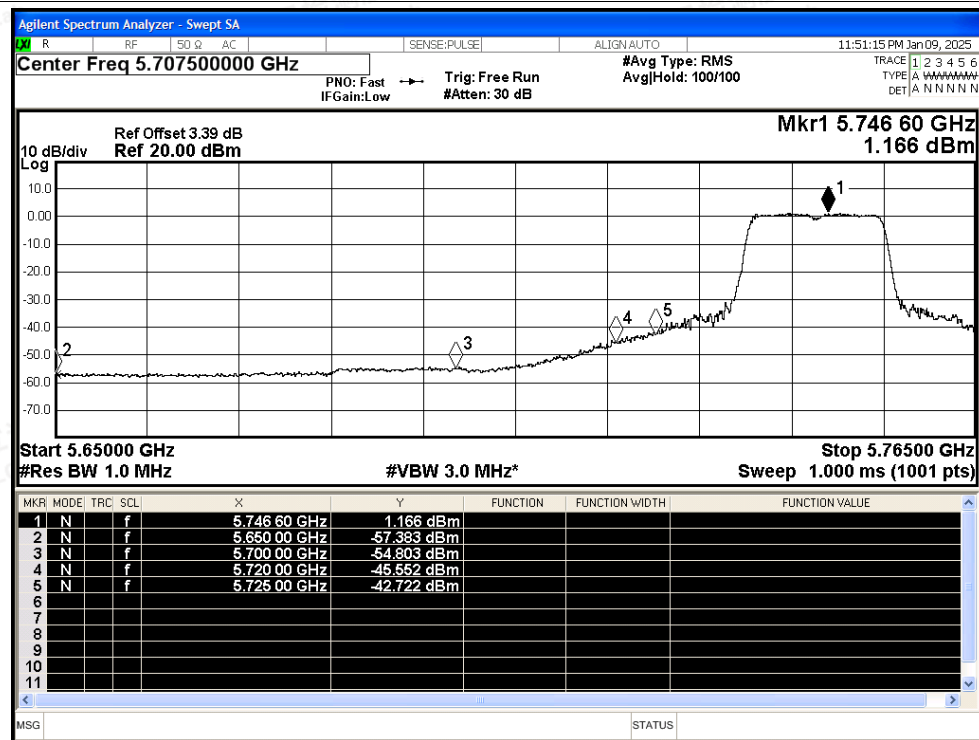

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT a 5825MHz Ant2 Peak

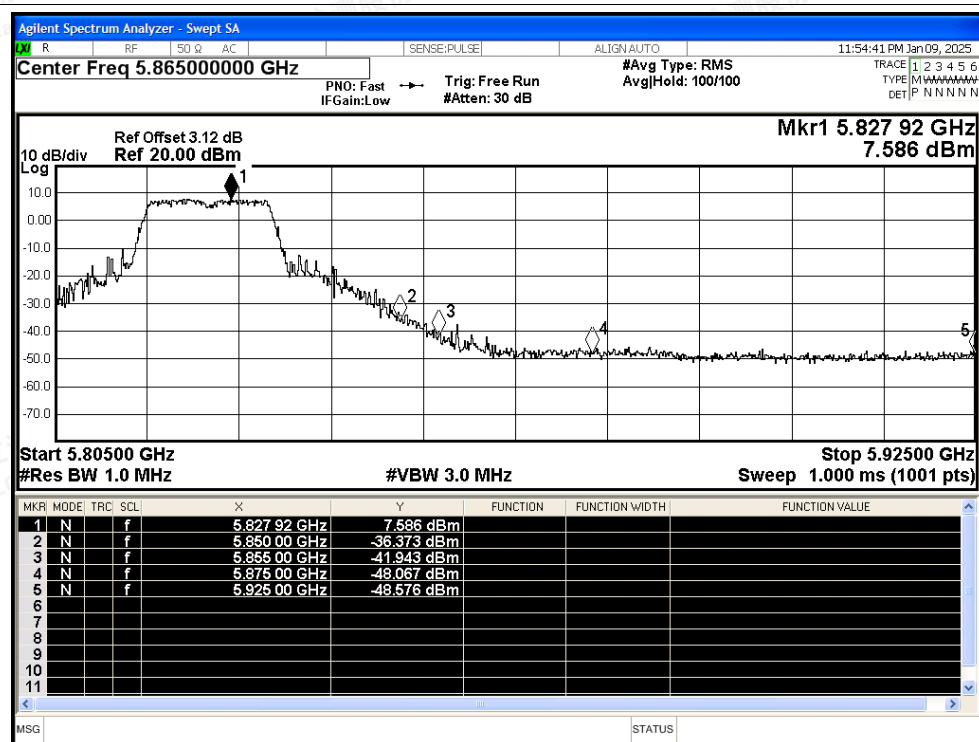

## Restrict Band NVNT a 5825MHz Ant2 Average

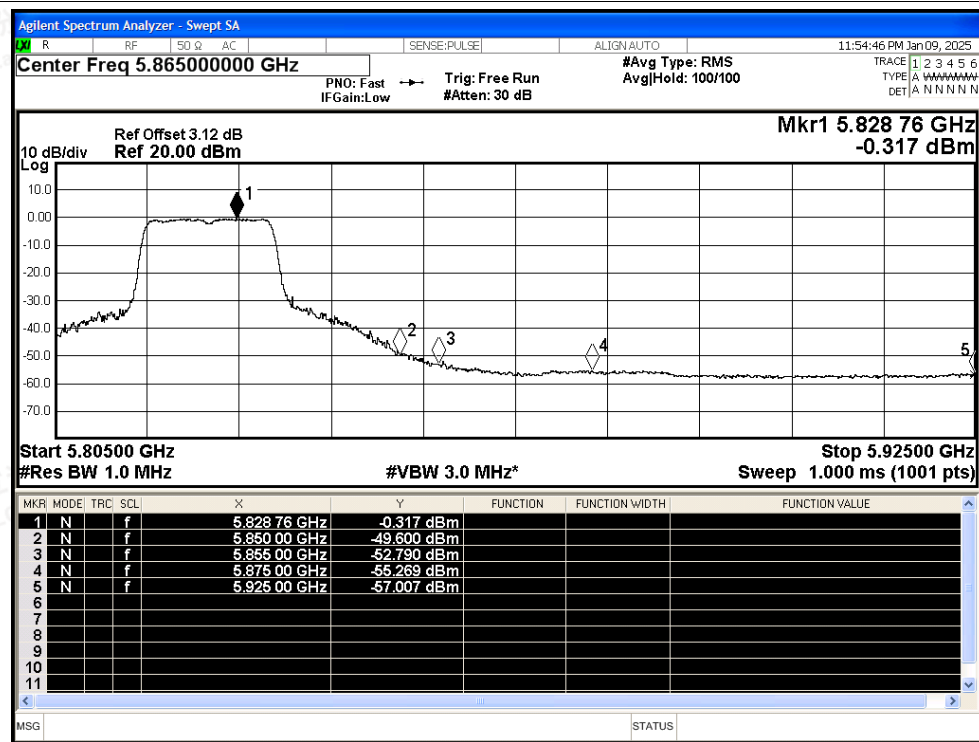

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5745MHz Ant2 Peak

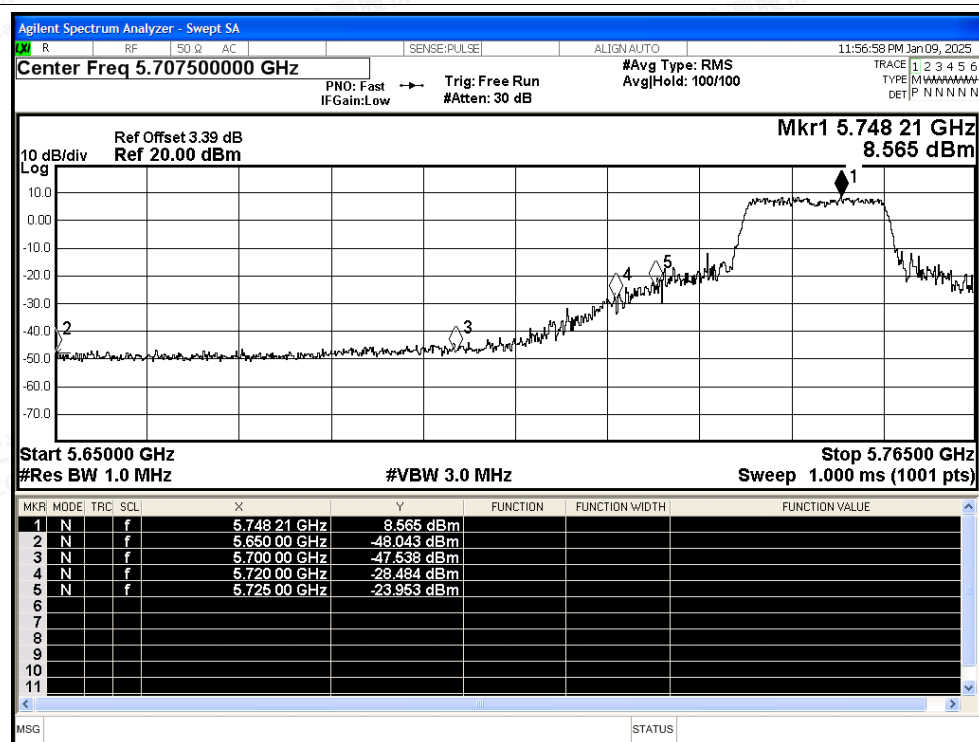

## Restrict Band NVNT n20 5745MHz Ant2 Average

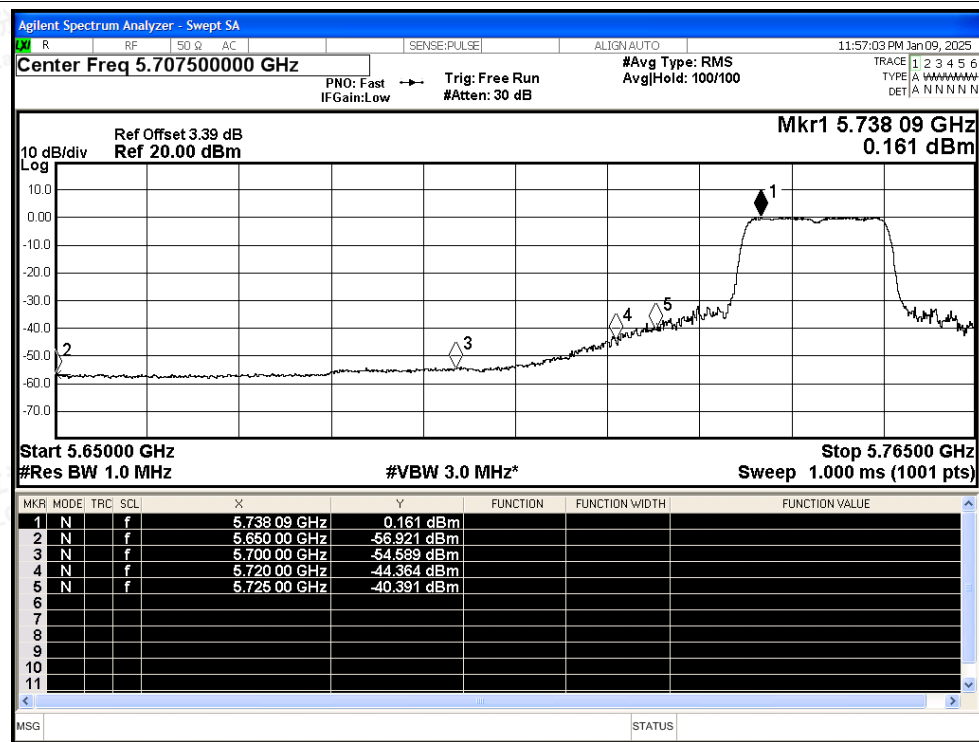

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT n20 5825MHz Ant2 Peak

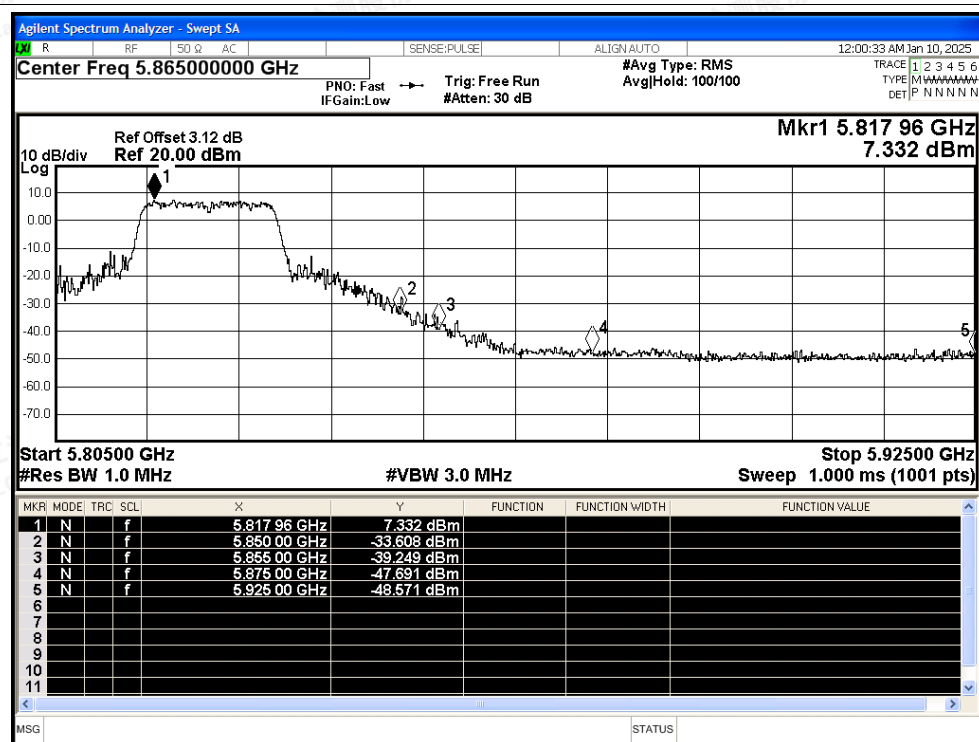

## Restrict Band NVNT n20 5825MHz Ant2 Average

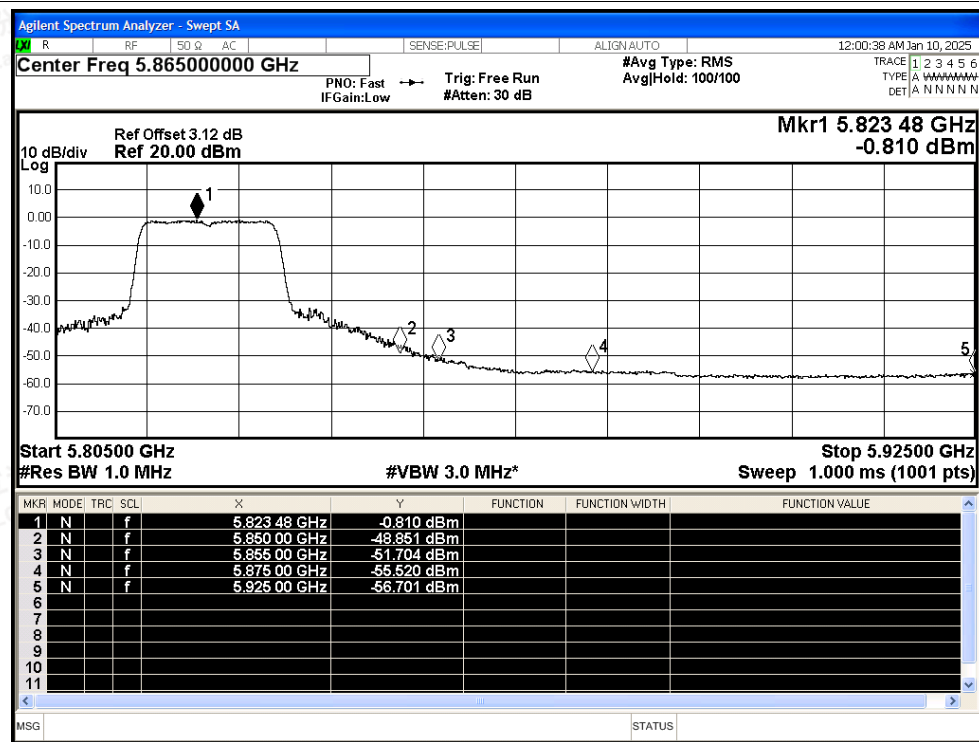

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5755MHz Ant2 Peak

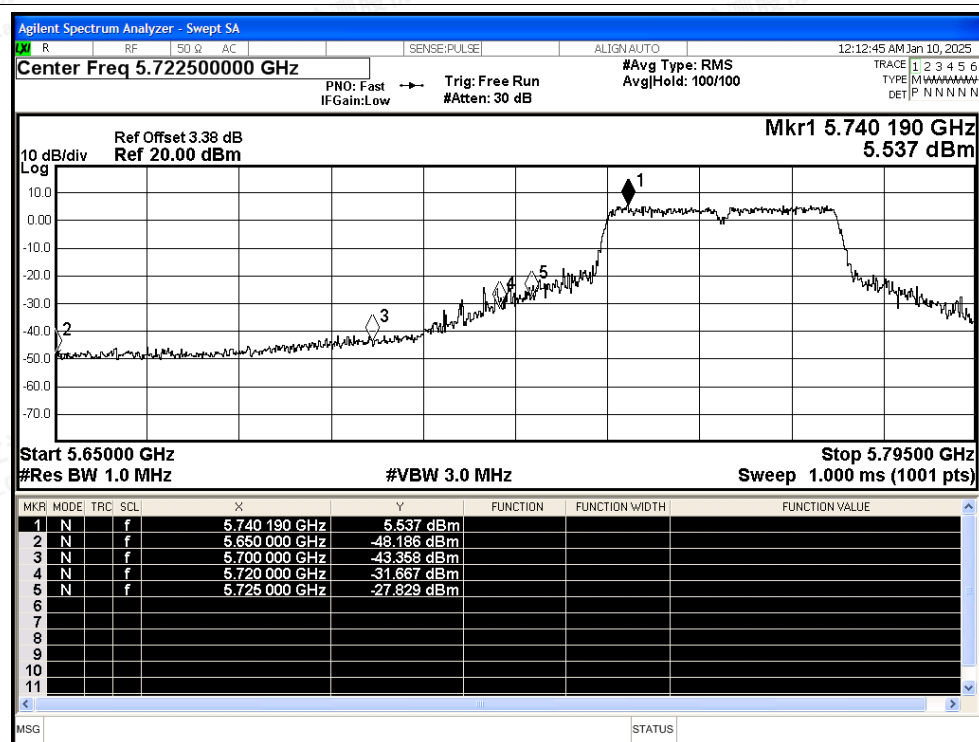

## Restrict Band NVNT n40 5755MHz Ant2 Average

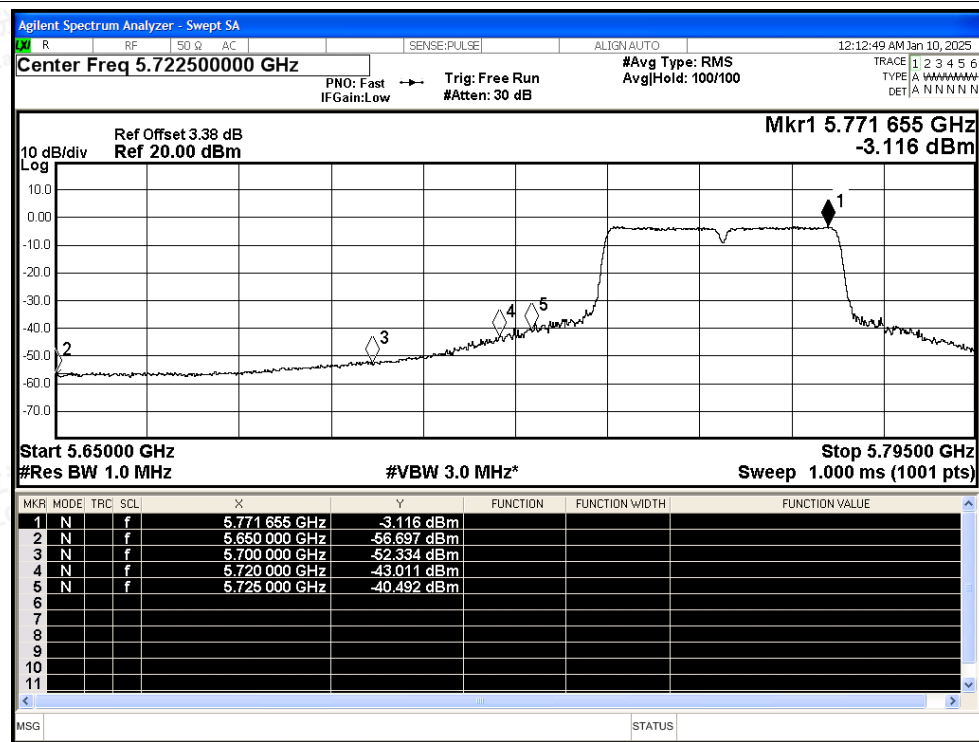

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT n40 5795MHz Ant2 Peak

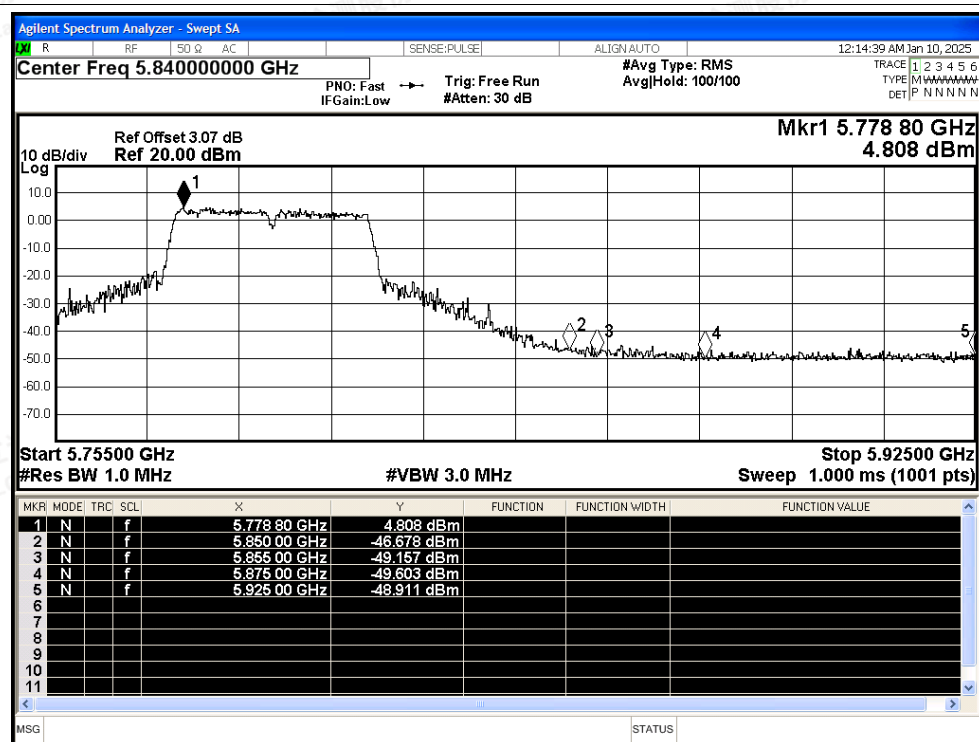

## Restrict Band NVNT n40 5795MHz Ant2 Average

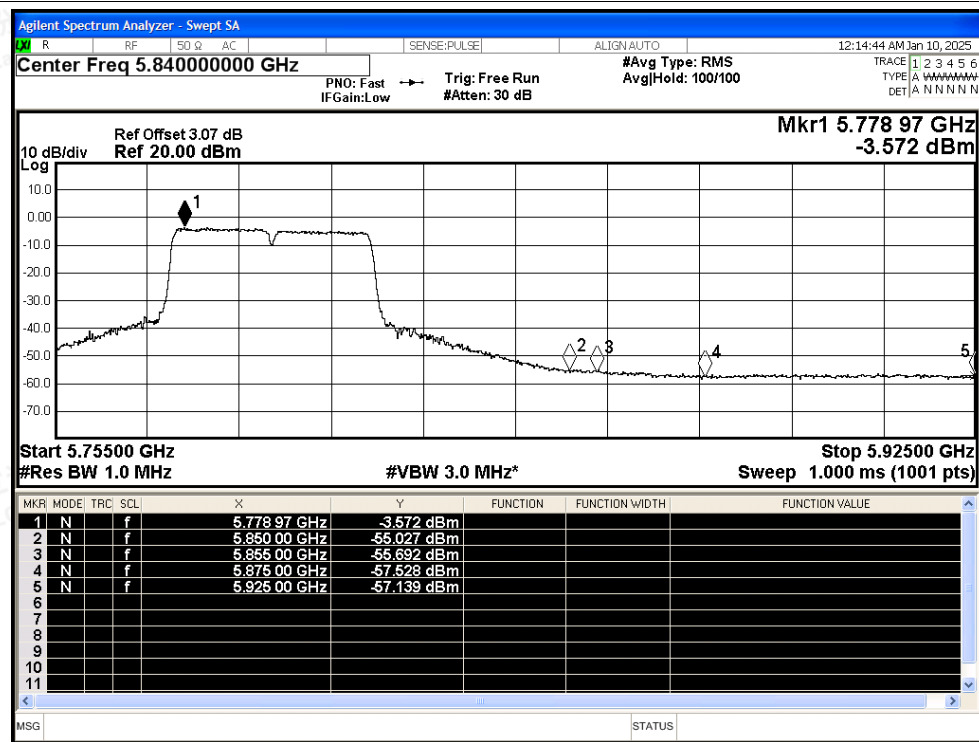

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5745MHz Ant2 Peak

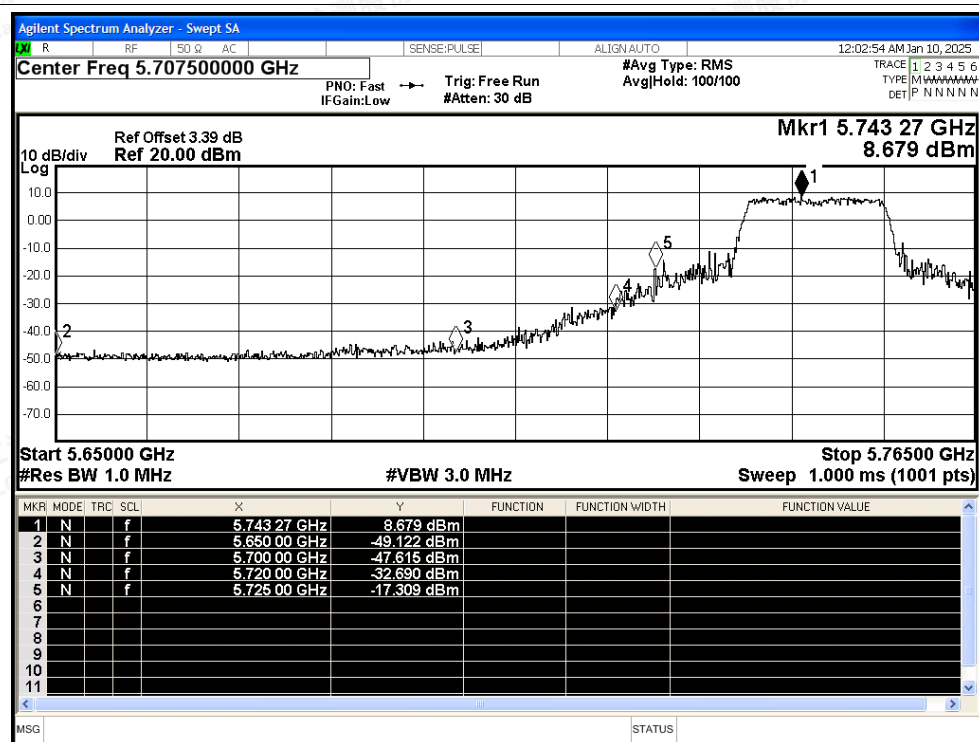

## Restrict Band NVNT ac20 5745MHz Ant2 Average

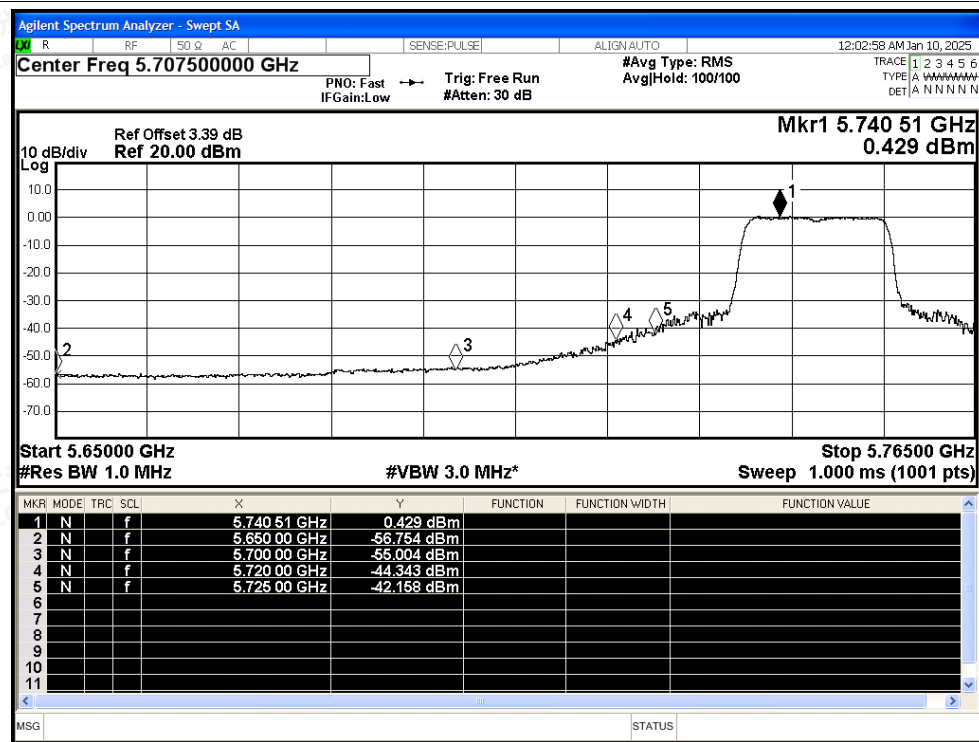

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5825MHz Ant2 Peak

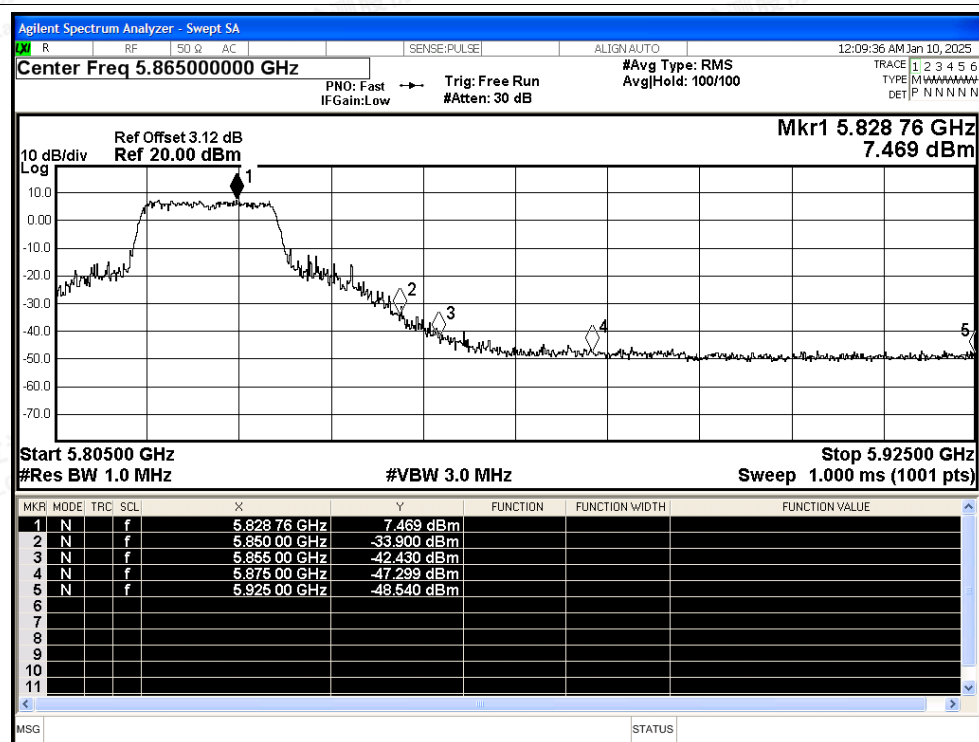

## Restrict Band NVNT ac20 5825MHz Ant2 Average

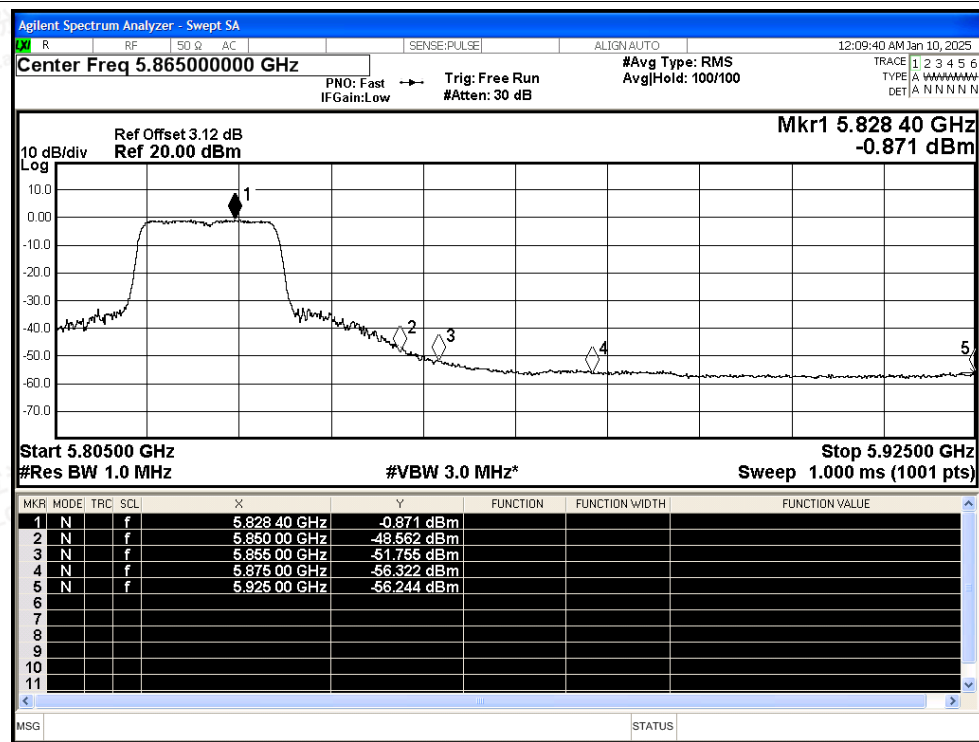

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5755MHz Ant2 Peak

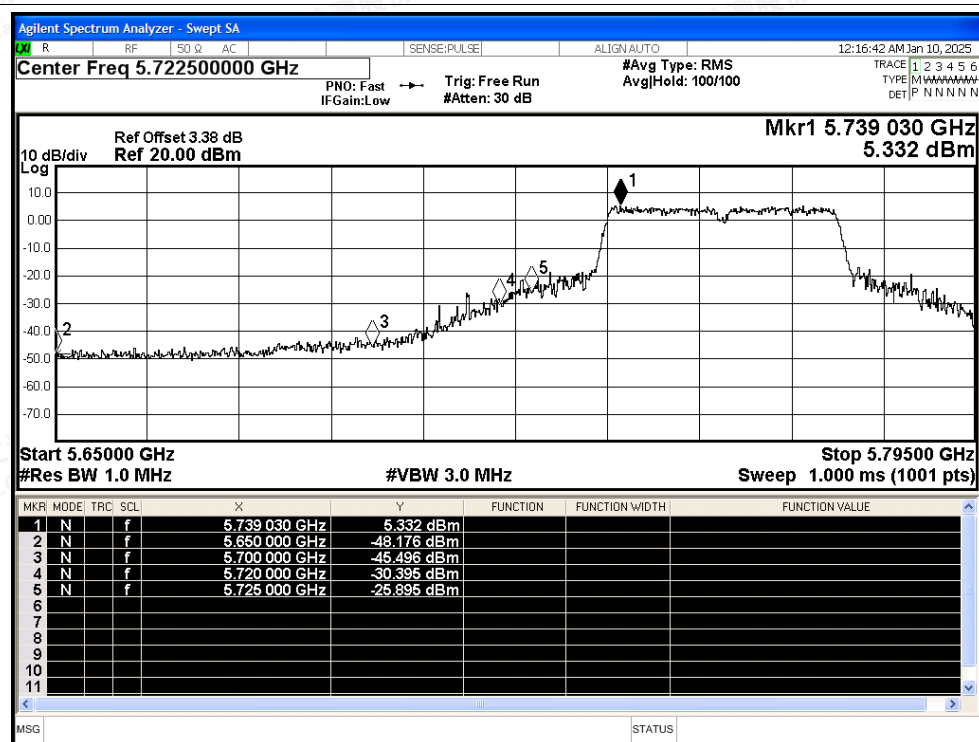

## Restrict Band NVNT ac40 5755MHz Ant2 Average

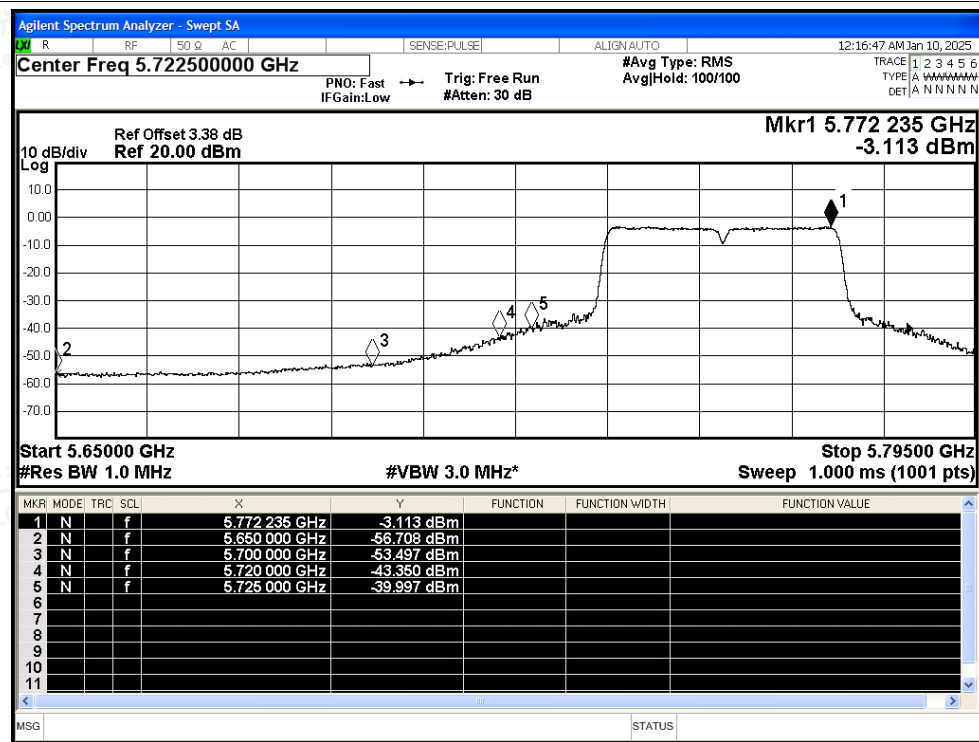

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5795MHz Ant2 Peak

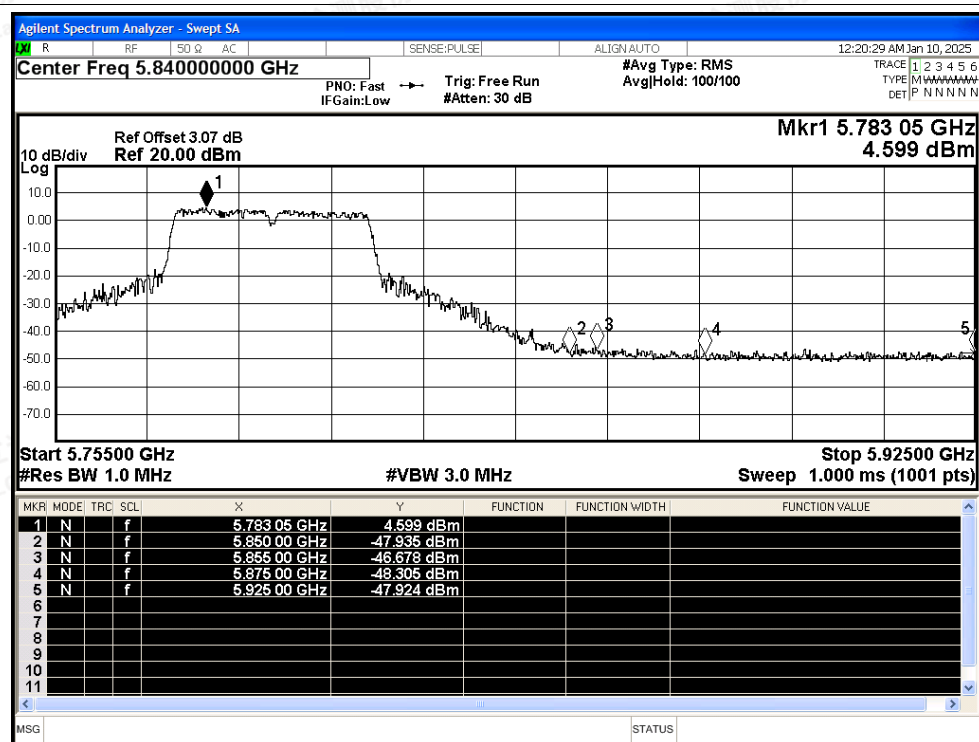

## Restrict Band NVNT ac40 5795MHz Ant2 Average

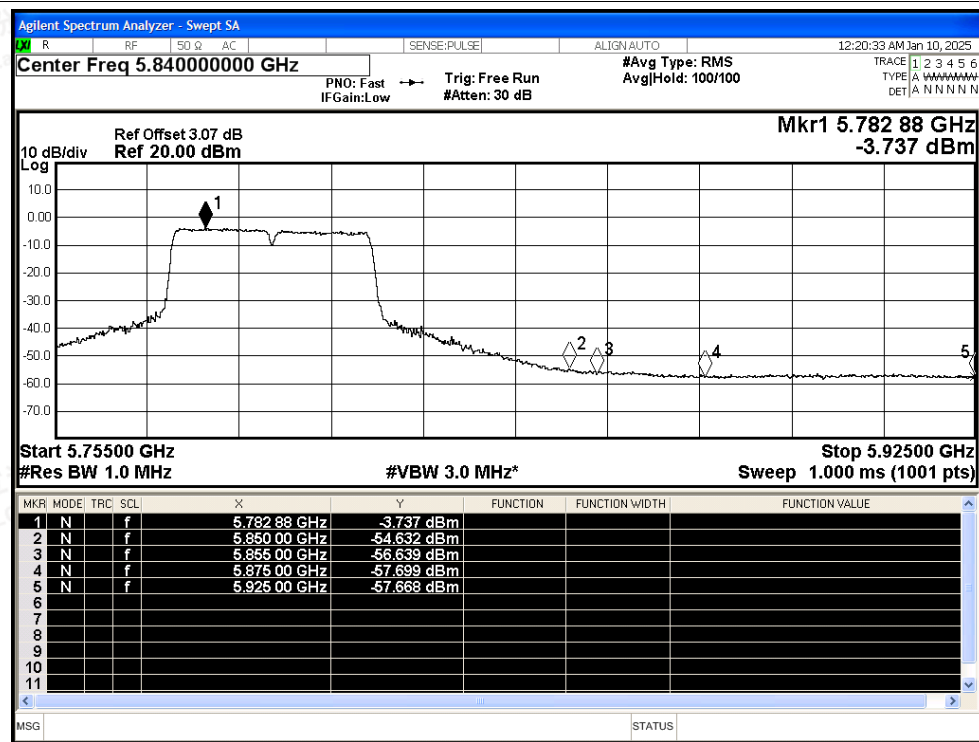

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5775MHz Ant2 Peak

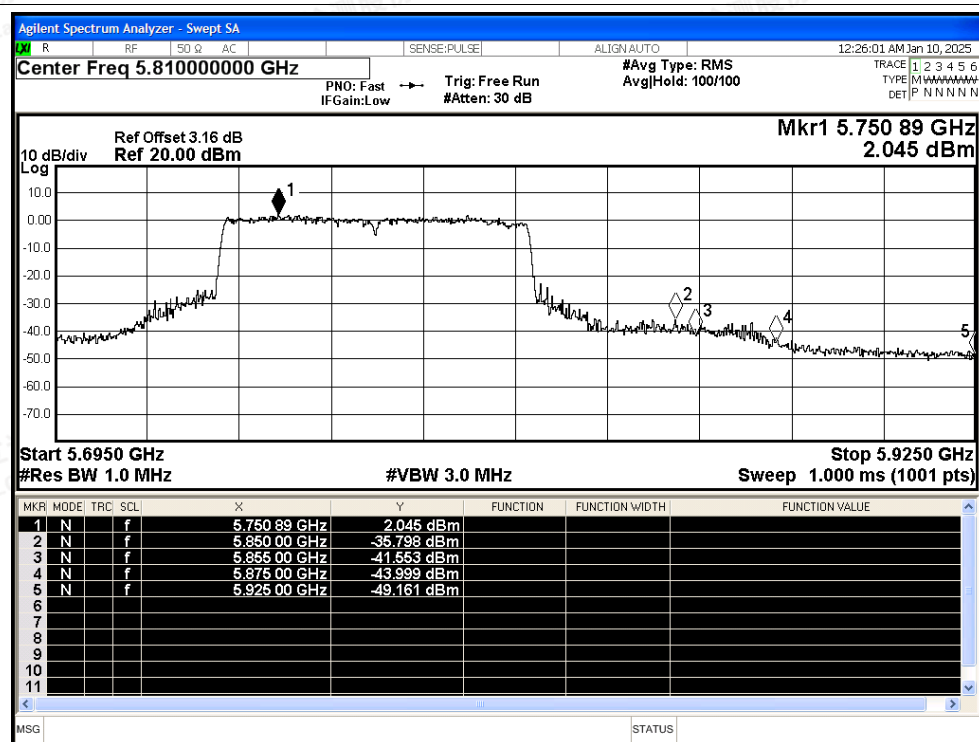

## Restrict Band NVNT ac80 5775MHz Ant2 Average

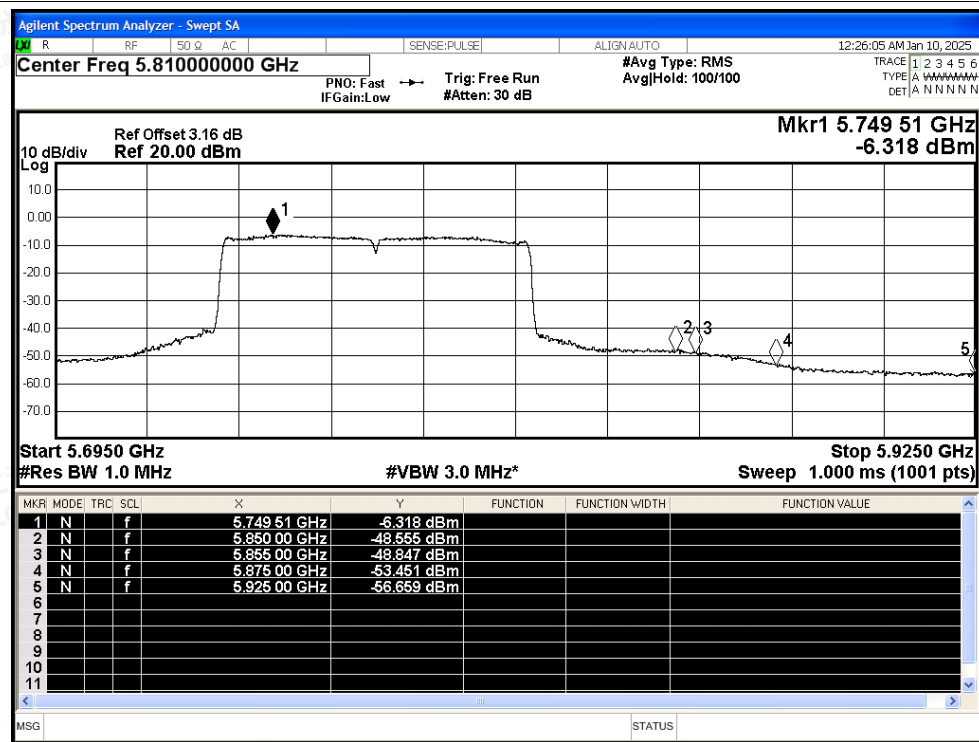

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT ac80 5775MHz Ant2 Peak

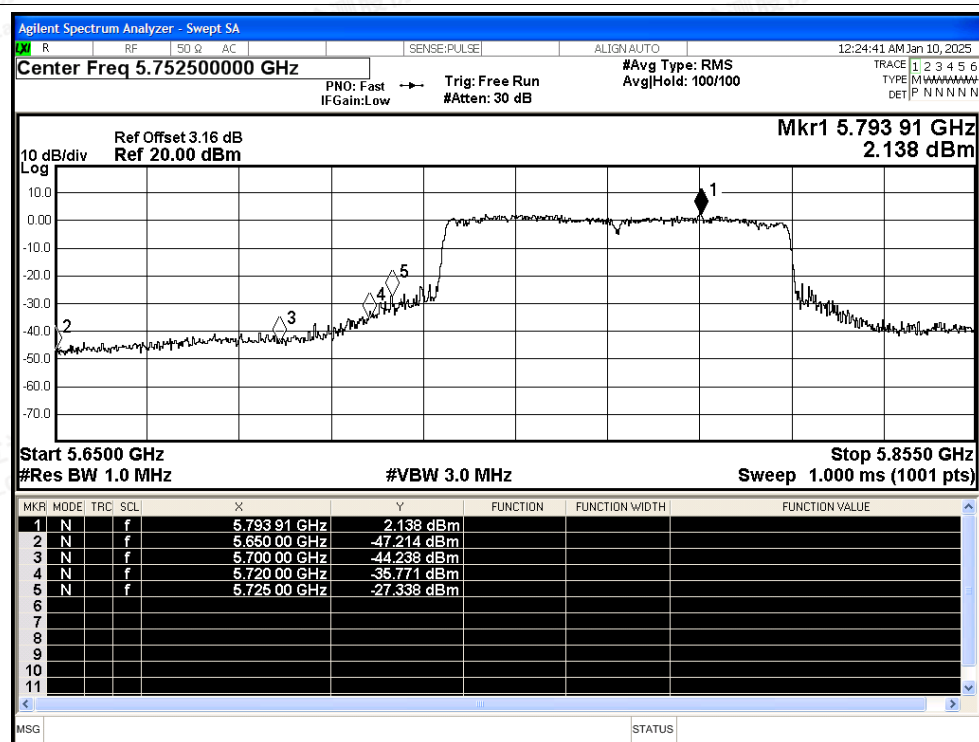

## Restrict Band NVNT ac80 5775MHz Ant2 Average

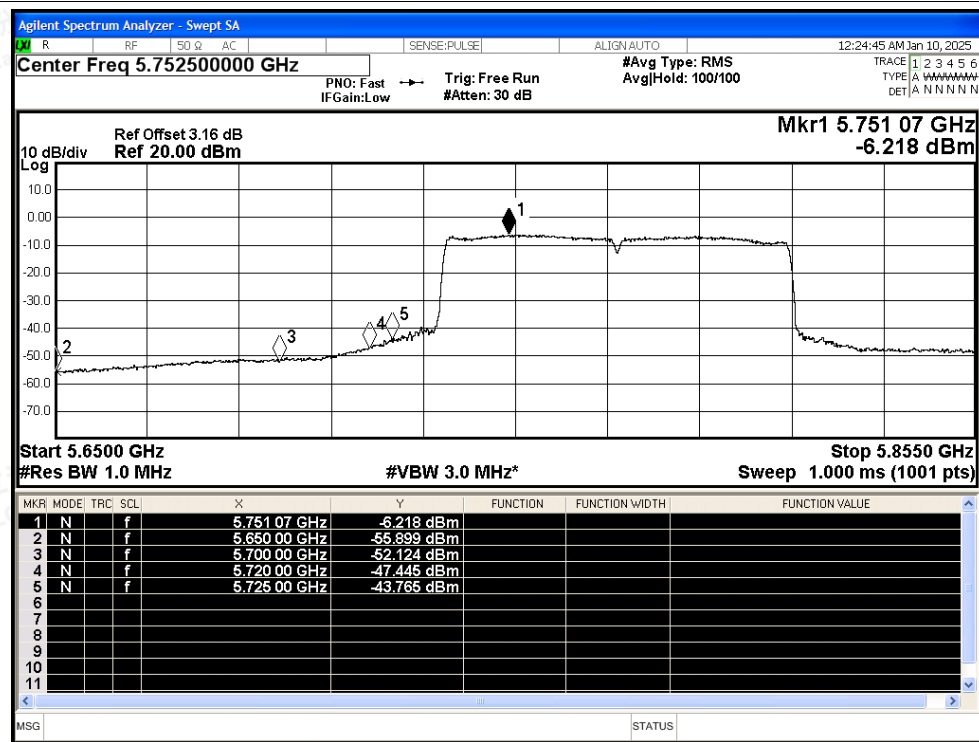

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5745MHz Ant2 Peak

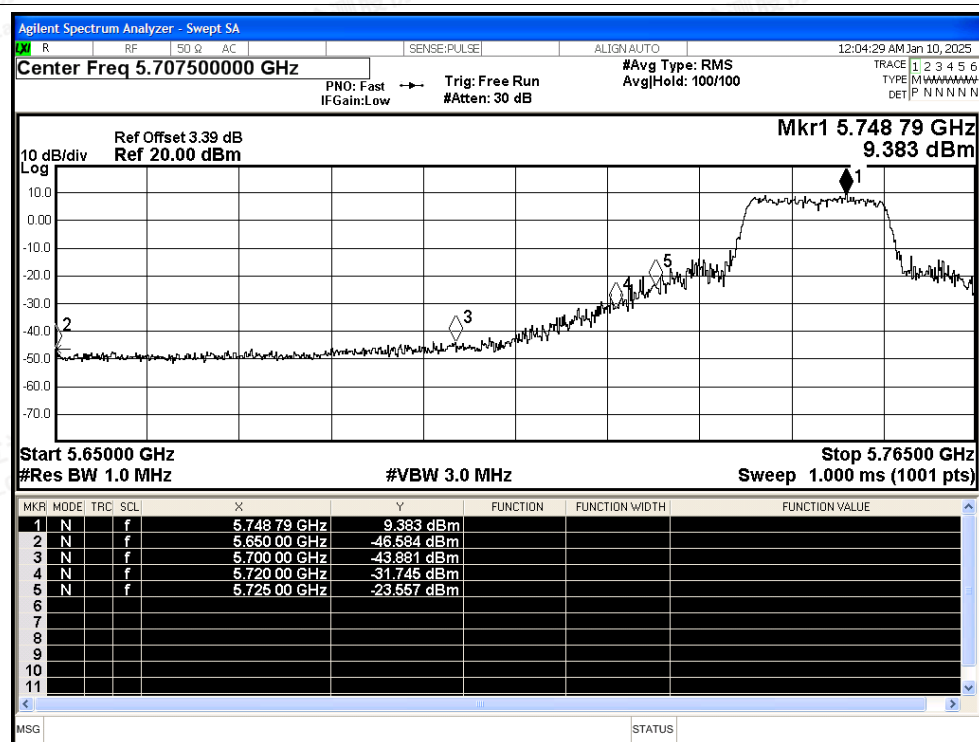

## Restrict Band NVNT ax20 5745MHz Ant2 Average

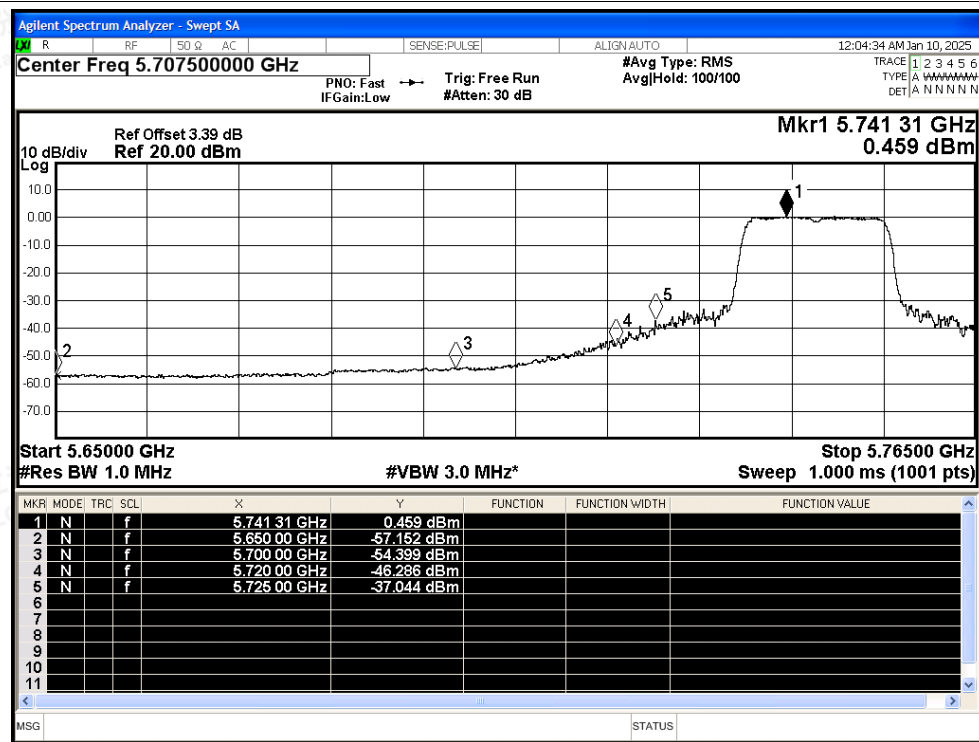

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5825MHz Ant2 Peak

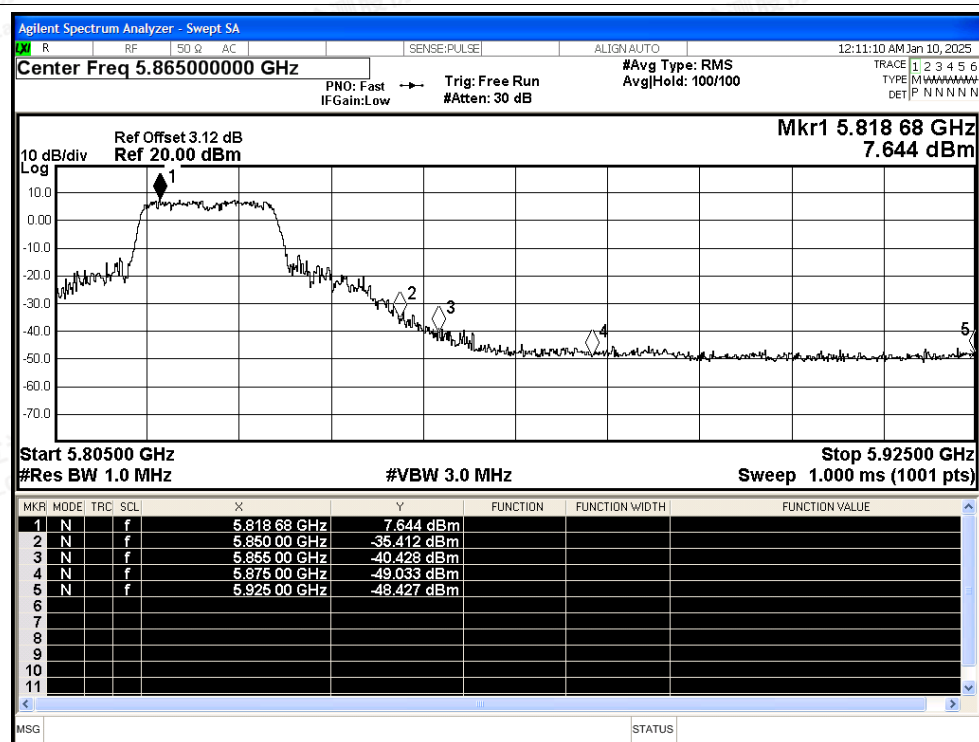

## Restrict Band NVNT ax20 5825MHz Ant2 Average

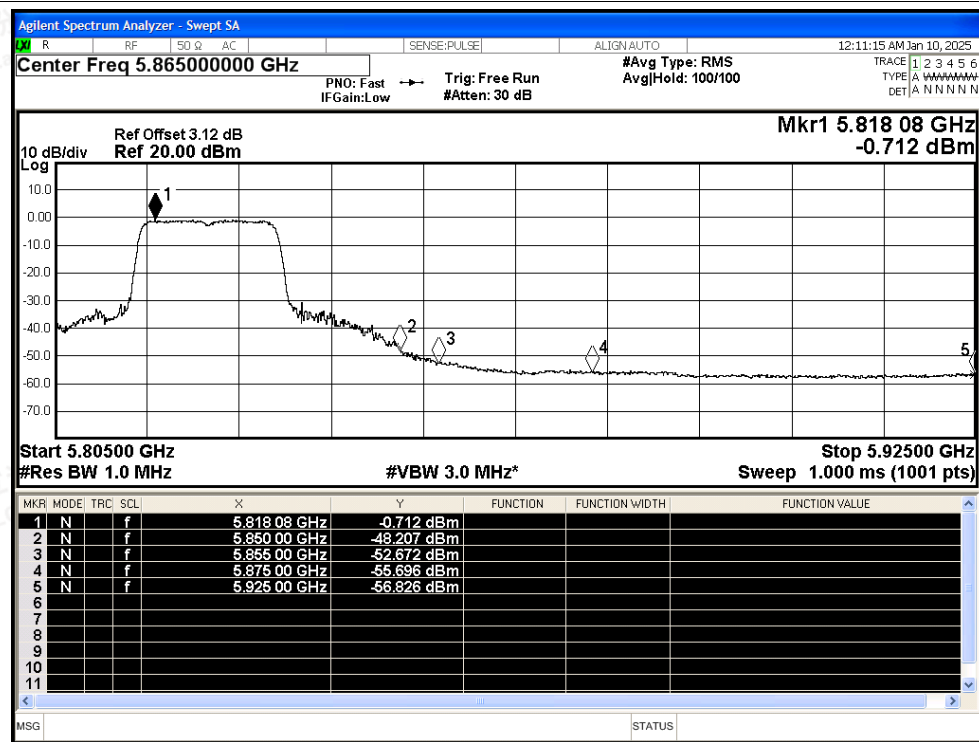

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5755MHz Ant2 Peak

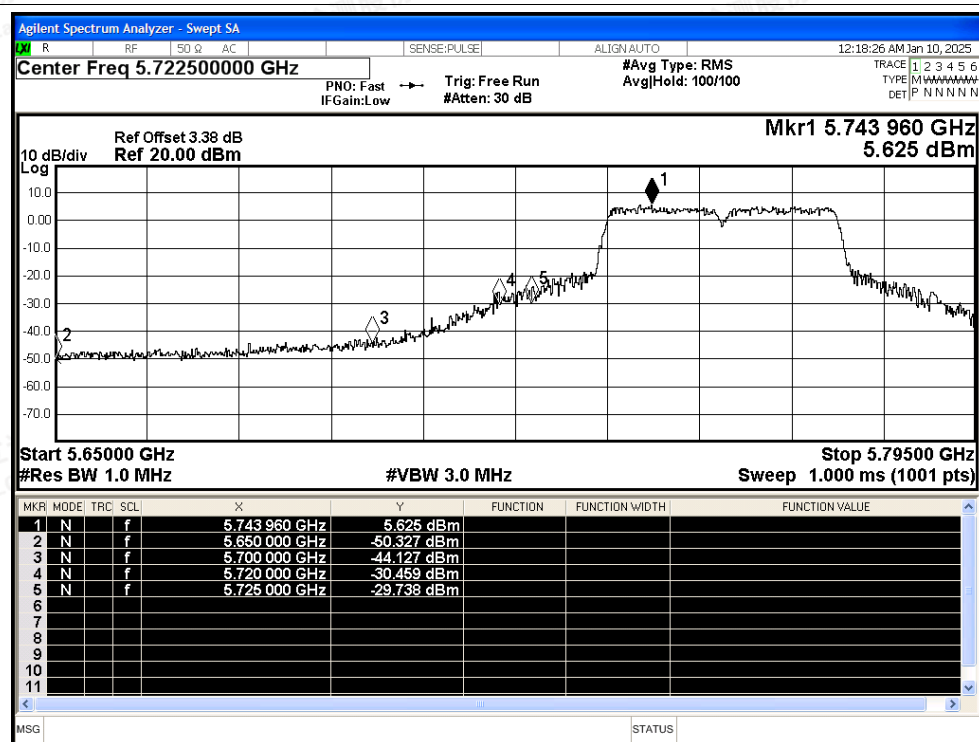

## Restrict Band NVNT ax40 5755MHz Ant2 Average

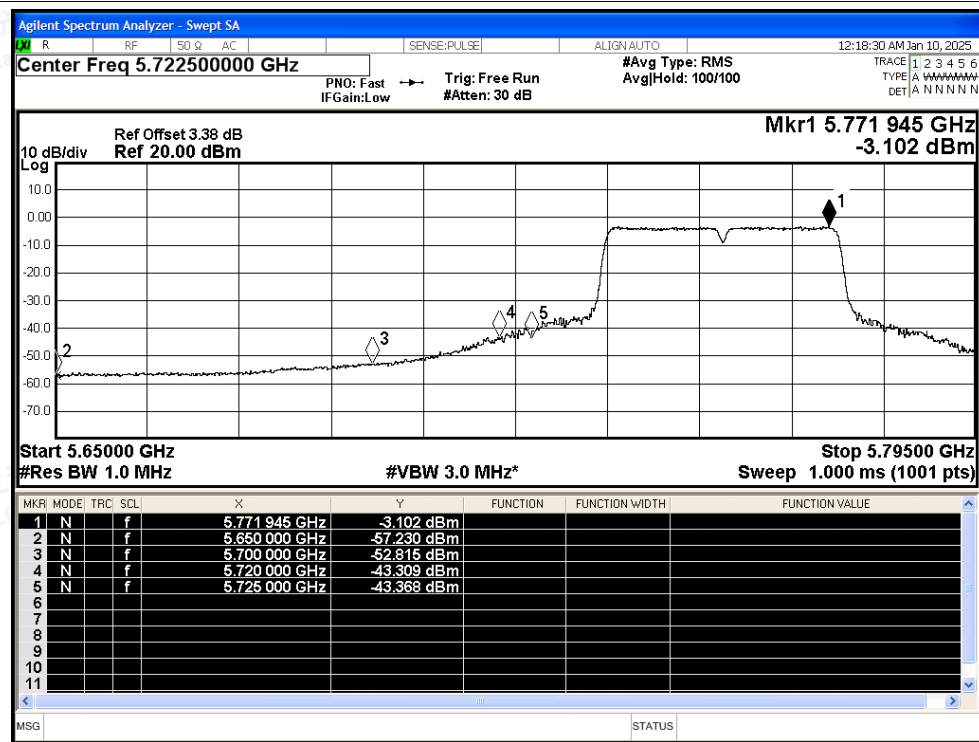

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5795MHz Ant2 Peak

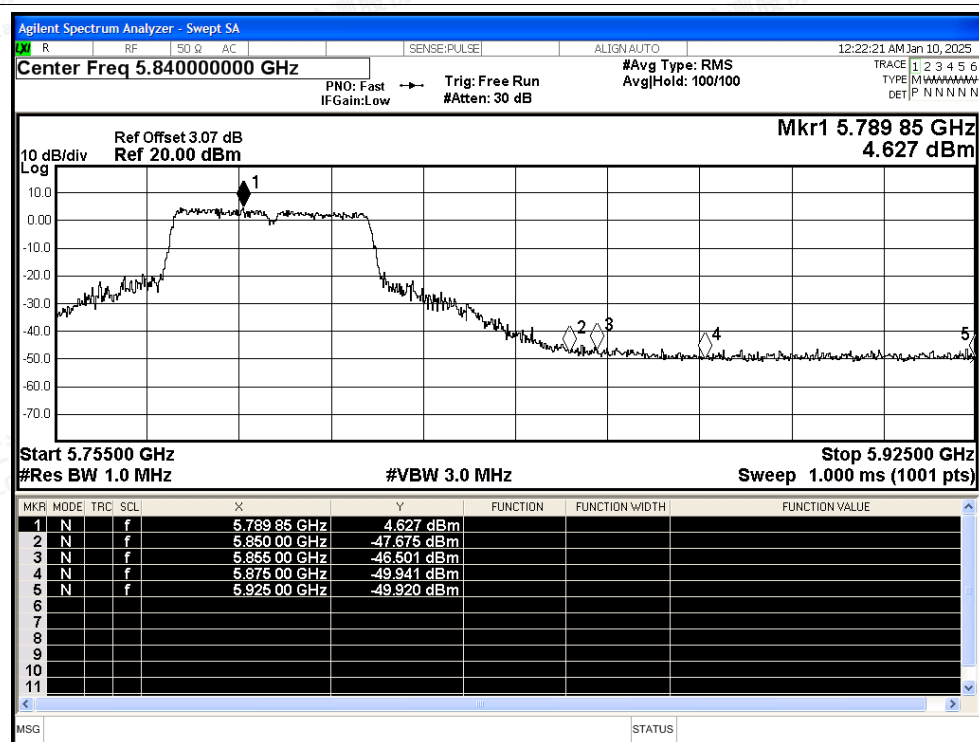

## Restrict Band NVNT ax40 5795MHz Ant2 Average

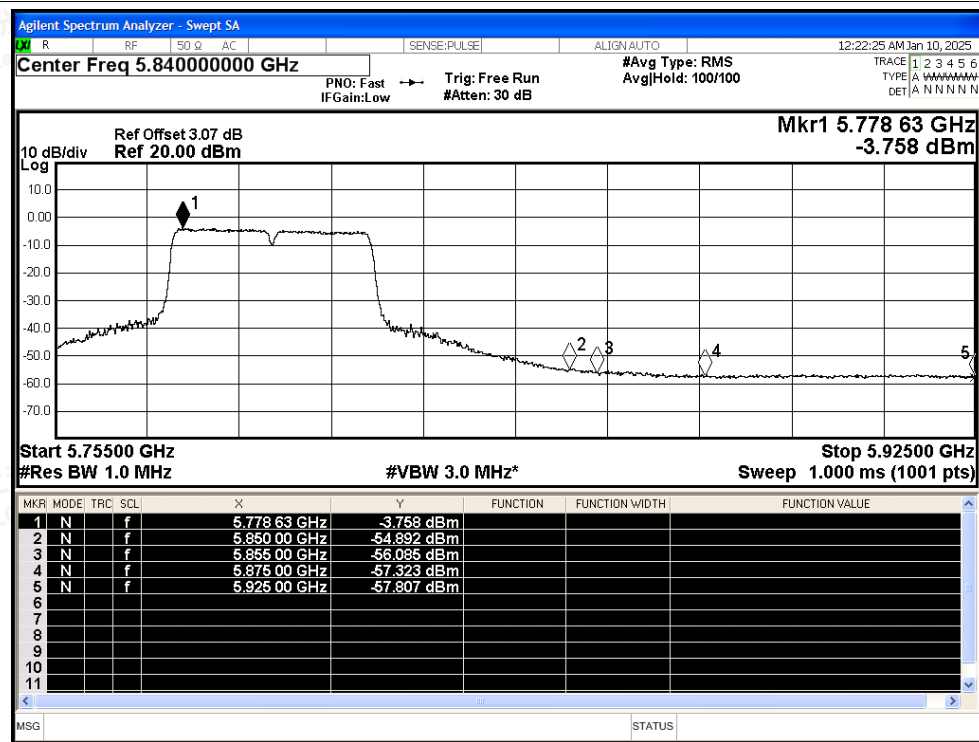

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5775MHz Ant2 Peak

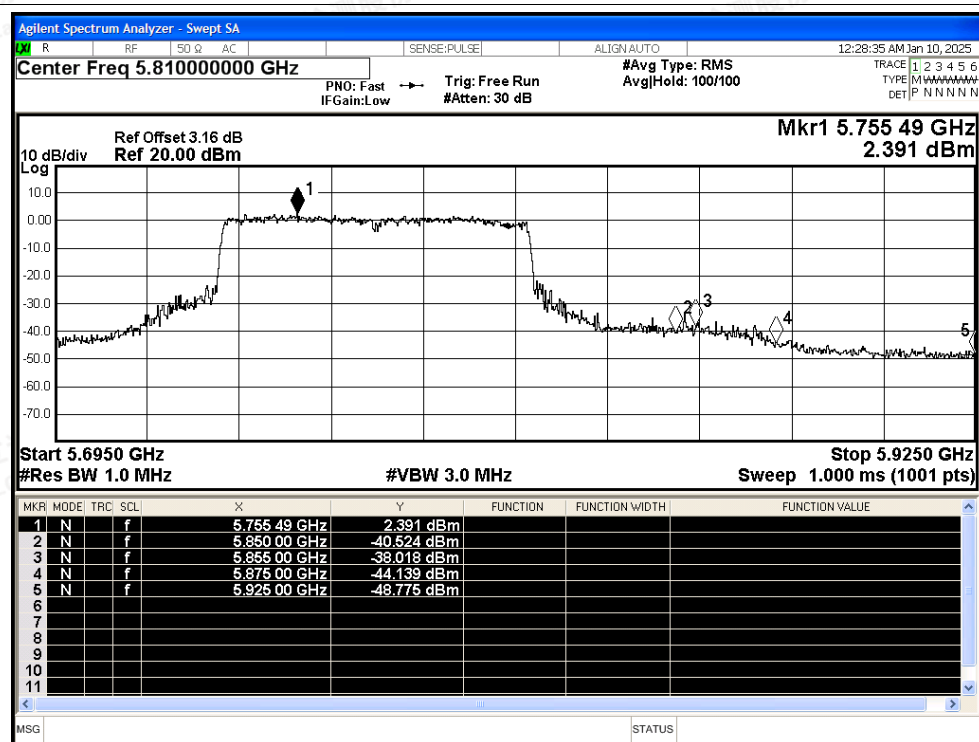

## Restrict Band NVNT ax80 5775MHz Ant2 Average

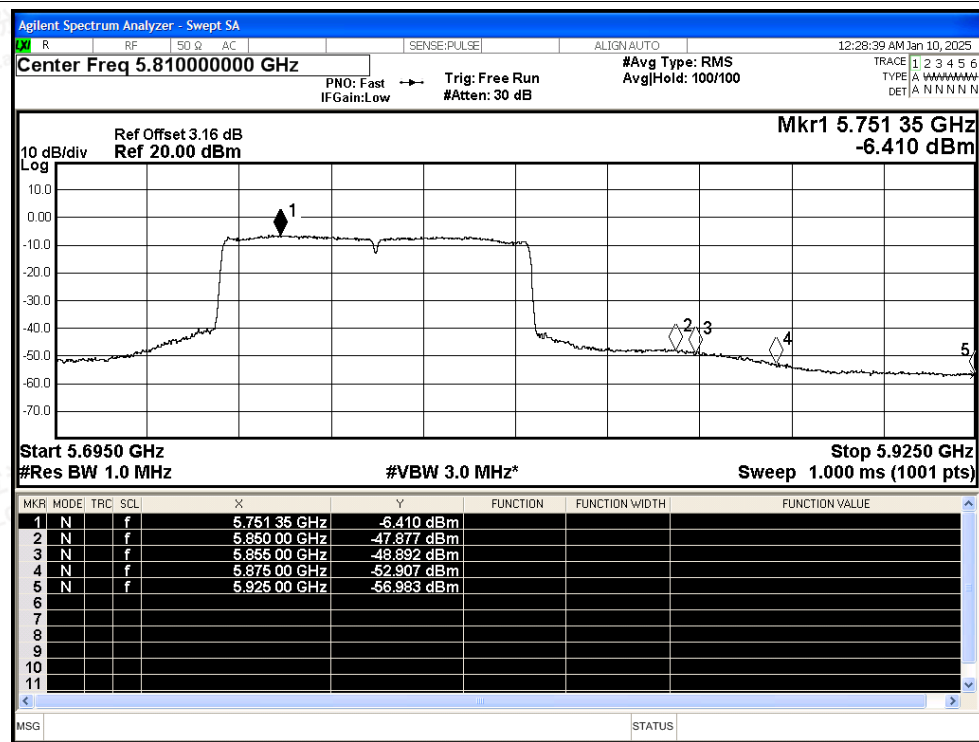

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT ax80 5775MHz Ant2 Peak

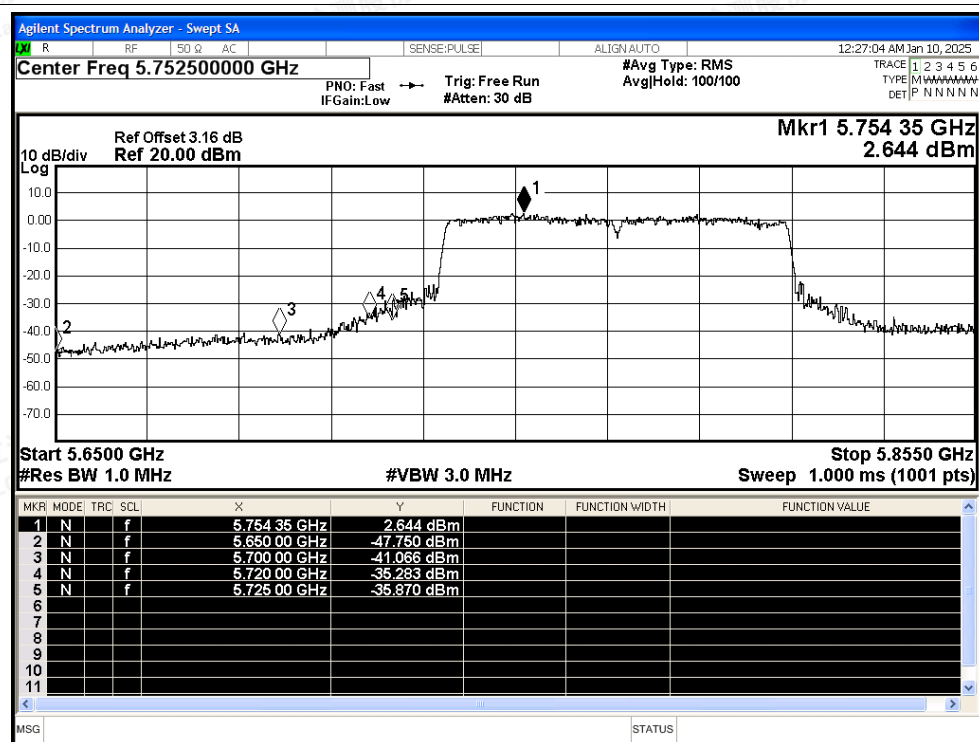

## Restrict Band NVNT ax80 5775MHz Ant2 Average

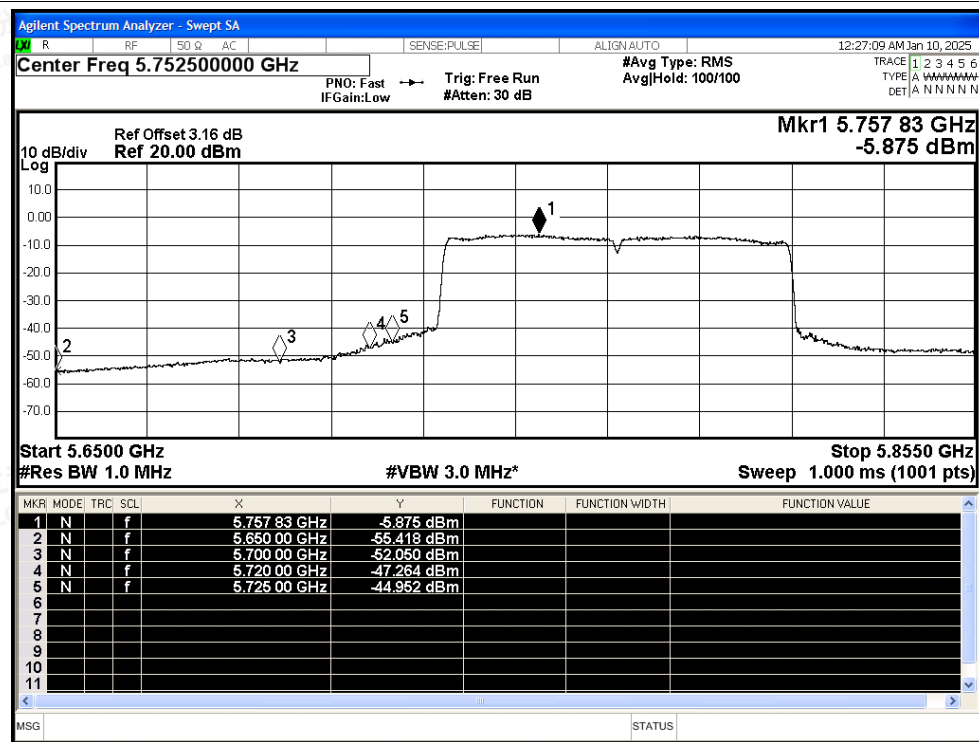

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

| Condition | Mode | Frequency<br>(MHz) | Spur Freq<br>(MHz) | ANT1<br>Power<br>(dBm) | ANT2<br>Power<br>(dBm) | Gain<br>(dBi) | EIRP<br>Power<br>(dBm) | Detector | Limit<br>(dBm) | Verdict |
|-----------|------|--------------------|--------------------|------------------------|------------------------|---------------|------------------------|----------|----------------|---------|
| NVNT      | n20  | 5745               | 5650               | -50.07                 | -48.04                 | 5.95          | -39.98                 | Peak     | -27            | Pass    |
| NVNT      | n20  | 5745               | 5650               | -57.66                 | -56.92                 | 5.95          | -48.31                 | Average  | -27            | Pass    |
| NVNT      | n20  | 5745               | 5700               | -49.06                 | -47.54                 | 5.95          | -39.27                 | Peak     | 10             | Pass    |
| NVNT      | n20  | 5745               | 5700               | -57.38                 | -54.59                 | 5.95          | -46.8                  | Average  | 10             | Pass    |
| NVNT      | n20  | 5745               | 5720               | -38.19                 | -28.48                 | 5.95          | -22.09                 | Peak     | 15.6           | Pass    |
| NVNT      | n20  | 5745               | 5720               | -54.55                 | -44.36                 | 5.95          | -38.01                 | Average  | 15.6           | Pass    |
| NVNT      | n20  | 5745               | 5725               | -27.62                 | -23.95                 | 5.95          | -16.45                 | Peak     | 27             | Pass    |
| NVNT      | n20  | 5745               | 5725               | -50.13                 | -40.39                 | 5.95          | -34                    | Average  | 27             | Pass    |
| NVNT      | n20  | 5825               | 5850               | -43.1                  | -33.61                 | 5.95          | -27.2                  | Peak     | 27             | Pass    |
| NVNT      | n20  | 5825               | 5850               | -52.53                 | -48.85                 | 5.95          | -41.35                 | Average  | 27             | Pass    |
| NVNT      | n20  | 5825               | 5855               | -45.5                  | -39.25                 | 5.95          | -32.38                 | Peak     | 15.6           | Pass    |
| NVNT      | n20  | 5825               | 5855               | -57.02                 | -51.7                  | 5.95          | -44.63                 | Average  | 15.6           | Pass    |
| NVNT      | n20  | 5825               | 5875               | -50.23                 | -47.69                 | 5.95          | -39.82                 | Peak     | 10             | Pass    |
| NVNT      | n20  | 5825               | 5875               | -57.69                 | -55.52                 | 5.95          | -47.51                 | Average  | 10             | Pass    |
| NVNT      | n20  | 5825               | 5925               | -48.84                 | -48.57                 | 5.95          | -39.74                 | Peak     | -27            | Pass    |
| NVNT      | n20  | 5825               | 5925               | -57.59                 | -56.7                  | 5.95          | -48.16                 | Average  | -27            | Pass    |
| NVNT      | n40  | 5755               | 5650               | -49.27                 | -48.19                 | 5.95          | -39.74                 | Peak     | -27            | Pass    |
| NVNT      | n40  | 5755               | 5650               | -56.98                 | -56.7                  | 5.95          | -47.88                 | Average  | -27            | Pass    |
| NVNT      | n40  | 5755               | 5700               | -44.72                 | -43.36                 | 5.95          | -35.03                 | Peak     | 10             | Pass    |
| NVNT      | n40  | 5755               | 5700               | -53.17                 | -52.33                 | 5.95          | -43.77                 | Average  | 10             | Pass    |
| NVNT      | n40  | 5755               | 5720               | -31.16                 | -31.67                 | 5.95          | -22.45                 | Peak     | 15.6           | Pass    |
| NVNT      | n40  | 5755               | 5720               | -45.65                 | -43.01                 | 5.95          | -35.17                 | Average  | 15.6           | Pass    |
| NVNT      | n40  | 5755               | 5725               | -26.89                 | -27.83                 | 5.95          | -18.37                 | Peak     | 27             | Pass    |
| NVNT      | n40  | 5755               | 5725               | -40.88                 | -40.49                 | 5.95          | -31.72                 | Average  | 27             | Pass    |
| NVNT      | n40  | 5795               | 5850               | -47.31                 | -46.68                 | 5.95          | -38.02                 | Peak     | 27             | Pass    |
| NVNT      | n40  | 5795               | 5850               | -55.25                 | -55.03                 | 5.95          | -46.18                 | Average  | 27             | Pass    |
| NVNT      | n40  | 5795               | 5855               | -45.63                 | -49.16                 | 5.95          | -38.09                 | Peak     | 15.6           | Pass    |
| NVNT      | n40  | 5795               | 5855               | -55.58                 | -55.69                 | 5.95          | -46.67                 | Average  | 15.6           | Pass    |
| NVNT      | n40  | 5795               | 5875               | -49.89                 | -49.6                  | 5.95          | -40.78                 | Peak     | 10             | Pass    |
| NVNT      | n40  | 5795               | 5875               | -57.83                 | -57.53                 | 5.95          | -48.72                 | Average  | 10             | Pass    |
| NVNT      | n40  | 5795               | 5925               | -48.48                 | -48.91                 | 5.95          | -39.73                 | Peak     | -27            | Pass    |
| NVNT      | n40  | 5795               | 5925               | -57.72                 | -57.14                 | 5.95          | -48.46                 | Average  | -27            | Pass    |
| NVNT      | ac20 | 5745               | 5650               | -48.48                 | -49.12                 | 5.95          | -39.83                 | Peak     | -27            | Pass    |
| NVNT      | ac20 | 5745               | 5650               | -57.53                 | -56.75                 | 5.95          | -48.16                 | Average  | -27            | Pass    |
| NVNT      | ac20 | 5745               | 5700               | -49.22                 | -47.62                 | 5.95          | -39.39                 | Peak     | 10             | Pass    |
| NVNT      | ac20 | 5745               | 5700               | -57.26                 | -55                    | 5.95          | -47.02                 | Average  | 10             | Pass    |
| NVNT      | ac20 | 5745               | 5720               | -39.18                 | -32.69                 | 5.95          | -25.86                 | Peak     | 15.6           | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |        |        |      |        |         |      |      |
|------|------|------|------|--------|--------|------|--------|---------|------|------|
| NVNT | ac20 | 5745 | 5720 | -53.39 | -44.34 | 5.95 | -37.88 | Average | 15.6 | Pass |
| NVNT | ac20 | 5745 | 5725 | -31.46 | -17.31 | 5.95 | -11.2  | Peak    | 27   | Pass |
| NVNT | ac20 | 5745 | 5725 | -49.54 | -42.16 | 5.95 | -35.48 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | 5850 | -33.57 | -33.9  | 5.95 | -24.77 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | 5850 | -46.47 | -48.56 | 5.95 | -38.43 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | 5855 | -38.06 | -42.43 | 5.95 | -30.76 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | 5855 | -52.07 | -51.76 | 5.95 | -42.95 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | 5875 | -47.7  | -47.3  | 5.95 | -38.54 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | 5875 | -55.79 | -56.32 | 5.95 | -47.09 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | 5925 | -46.83 | -48.54 | 5.95 | -38.64 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | 5925 | -56.72 | -56.24 | 5.95 | -47.51 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | 5650 | -49.9  | -48.18 | 5.95 | -40    | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | 5650 | -57.11 | -56.71 | 5.95 | -47.95 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | 5700 | -45.19 | -45.5  | 5.95 | -36.38 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | 5700 | -53    | -53.5  | 5.95 | -44.28 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | 5720 | -31.11 | -30.4  | 5.95 | -21.78 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | 5720 | -45.25 | -43.35 | 5.95 | -35.24 | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | 5725 | -23.81 | -25.9  | 5.95 | -15.77 | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | 5725 | -41.12 | -40    | 5.95 | -31.56 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | 5850 | -47.07 | -47.94 | 5.95 | -38.52 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | 5850 | -55.48 | -54.63 | 5.95 | -46.07 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | 5855 | -46.82 | -46.68 | 5.95 | -37.79 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5795 | 5855 | -55.94 | -56.64 | 5.95 | -47.32 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | 5875 | -49.14 | -48.31 | 5.95 | -39.74 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | 5875 | -57.26 | -57.7  | 5.95 | -48.51 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | 5925 | -50.66 | -47.92 | 5.95 | -40.12 | Peak    | -27  | Pass |
| NVNT | ac40 | 5795 | 5925 | -57.39 | -57.67 | 5.95 | -48.57 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | 5850 | -37.73 | -35.8  | 5.95 | -27.7  | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | 5850 | -48.37 | -48.56 | 5.95 | -39.5  | Average | 27   | Pass |
| NVNT | ac80 | 5775 | 5855 | -38.76 | -41.55 | 5.95 | -30.97 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5855 | -49.08 | -48.85 | 5.95 | -40    | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5875 | -42.73 | -44    | 5.95 | -34.36 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | 5875 | -53.33 | -53.45 | 5.95 | -44.43 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | 5925 | -49.03 | -49.16 | 5.95 | -40.13 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | 5925 | -57.01 | -56.66 | 5.95 | -47.87 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | 5650 | -47.25 | -47.21 | 5.95 | -38.27 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | 5650 | -56    | -55.9  | 5.95 | -46.99 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | 5700 | -41.68 | -44.24 | 5.95 | -33.81 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | 5700 | -50.4  | -52.12 | 5.95 | -42.22 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | 5720 | -35.5  | -35.77 | 5.95 | -26.67 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5720 | -46.86 | -47.45 | 5.95 | -38.18 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | 5725 | -32.71 | -27.34 | 5.95 | -20.28 | Peak    | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |        |        |      |        |         |      |      |
|------|------|------|------|--------|--------|------|--------|---------|------|------|
| NVNT | ac80 | 5775 | 5725 | -44.98 | -43.77 | 5.95 | -35.37 | Average | 27   | Pass |
| NVNT | ax20 | 5745 | 5650 | -50.08 | -46.58 | 5.95 | -39.03 | Peak    | -27  | Pass |
| NVNT | ax20 | 5745 | 5650 | -57.51 | -57.15 | 5.95 | -48.37 | Average | -27  | Pass |
| NVNT | ax20 | 5745 | 5700 | -48.41 | -43.88 | 5.95 | -36.62 | Peak    | 10   | Pass |
| NVNT | ax20 | 5745 | 5700 | -57.88 | -54.4  | 5.95 | -46.84 | Average | 10   | Pass |
| NVNT | ax20 | 5745 | 5720 | -38.94 | -31.75 | 5.95 | -25.04 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5745 | 5720 | -54.29 | -46.29 | 5.95 | -39.7  | Average | 15.6 | Pass |
| NVNT | ax20 | 5745 | 5725 | -33.89 | -23.56 | 5.95 | -17.23 | Peak    | 27   | Pass |
| NVNT | ax20 | 5745 | 5725 | -51.68 | -37.04 | 5.95 | -30.94 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | 5850 | -32.87 | -35.41 | 5.95 | -25    | Peak    | 27   | Pass |
| NVNT | ax20 | 5825 | 5850 | -46.09 | -48.21 | 5.95 | -38.06 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | 5855 | -37.57 | -40.43 | 5.95 | -29.81 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5825 | 5855 | -50.96 | -52.67 | 5.95 | -42.77 | Average | 15.6 | Pass |
| NVNT | ax20 | 5825 | 5875 | -47.68 | -49.03 | 5.95 | -39.34 | Peak    | 10   | Pass |
| NVNT | ax20 | 5825 | 5875 | -56.12 | -55.7  | 5.95 | -46.94 | Average | 10   | Pass |
| NVNT | ax20 | 5825 | 5925 | -48.73 | -48.43 | 5.95 | -39.62 | Peak    | -27  | Pass |
| NVNT | ax20 | 5825 | 5925 | -56.79 | -56.83 | 5.95 | -47.85 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | 5650 | -48.41 | -50.33 | 5.95 | -40.3  | Peak    | -27  | Pass |
| NVNT | ax40 | 5755 | 5650 | -57.06 | -57.23 | 5.95 | -48.18 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | 5700 | -44.15 | -44.13 | 5.95 | -35.18 | Peak    | 10   | Pass |
| NVNT | ax40 | 5755 | 5700 | -52.66 | -52.82 | 5.95 | -43.78 | Average | 10   | Pass |
| NVNT | ax40 | 5755 | 5720 | -28.84 | -30.46 | 5.95 | -20.61 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5755 | 5720 | -44.37 | -43.31 | 5.95 | -34.85 | Average | 15.6 | Pass |
| NVNT | ax40 | 5755 | 5725 | -23.6  | -29.74 | 5.95 | -16.7  | Peak    | 27   | Pass |
| NVNT | ax40 | 5755 | 5725 | -40.42 | -43.37 | 5.95 | -32.69 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | 5850 | -47.12 | -47.68 | 5.95 | -38.43 | Peak    | 27   | Pass |
| NVNT | ax40 | 5795 | 5850 | -55.54 | -54.89 | 5.95 | -46.24 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | 5855 | -46.88 | -46.5  | 5.95 | -37.73 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5795 | 5855 | -56.15 | -56.09 | 5.95 | -47.16 | Average | 15.6 | Pass |
| NVNT | ax40 | 5795 | 5875 | -49.46 | -49.94 | 5.95 | -40.73 | Peak    | 10   | Pass |
| NVNT | ax40 | 5795 | 5875 | -57.32 | -57.32 | 5.95 | -48.36 | Average | 10   | Pass |
| NVNT | ax40 | 5795 | 5925 | -48.82 | -49.92 | 5.95 | -40.37 | Peak    | -27  | Pass |
| NVNT | ax40 | 5795 | 5925 | -57.63 | -57.81 | 5.95 | -48.76 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | 5850 | -39.43 | -40.52 | 5.95 | -30.98 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | 5850 | -48.24 | -47.88 | 5.95 | -39.1  | Average | 27   | Pass |
| NVNT | ax80 | 5775 | 5855 | -40.45 | -38.02 | 5.95 | -30.11 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5855 | -48.77 | -48.89 | 5.95 | -39.87 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5875 | -42.82 | -44.14 | 5.95 | -34.47 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | 5875 | -53.98 | -52.91 | 5.95 | -44.45 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | 5925 | -50.03 | -48.78 | 5.95 | -40.4  | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | 5925 | -56.51 | -56.98 | 5.95 | -47.78 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | 5650 | -47.26 | -47.75 | 5.95 | -38.54 | Peak    | -27  | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |        |        |      |        |         |      |      |
|------|------|------|------|--------|--------|------|--------|---------|------|------|
| NVNT | ax80 | 5775 | 5650 | -56.02 | -55.42 | 5.95 | -46.75 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | 5700 | -42.63 | -41.07 | 5.95 | -32.82 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | 5700 | -50.83 | -52.05 | 5.95 | -42.44 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | 5720 | -36.44 | -35.28 | 5.95 | -26.86 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5720 | -46.7  | -47.26 | 5.95 | -38.01 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | 5725 | -27.91 | -35.87 | 5.95 | -21.32 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | 5725 | -43.27 | -44.95 | 5.95 | -35.07 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.5 Frequency Stability

| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5745            | Ant1    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | a    | 5785            | Ant1    | 5785                     | 0                    | 0               | 25          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5824.98                  | -20000               | -3.43           | 25          | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | n20  | 5785            | Ant1    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5824.96                  | -40000               | -6.87           | 25          | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5755                     | 0                    | 0               | 25          | Pass    |
| NVNT      | n40  | 5795            | Ant1    | 5795                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | 5784.96                  | -40000               | -6.91           | 25          | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | 5824.98                  | -20000               | -3.43           | 25          | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | 5775                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5745            | Ant1    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ax20 | 5785            | Ant1    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | ax20 | 5825            | Ant1    | 5824.98                  | -20000               | -3.43           | 25          | Pass    |
| NVNT      | ax40 | 5755            | Ant1    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | ax40 | 5795            | Ant1    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ax80 | 5775            | Ant1    | 5775                     | 0                    | 0               | 25          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity






## Test Graphs

## Freq. Stability NVNT a 5745MHz Ant1

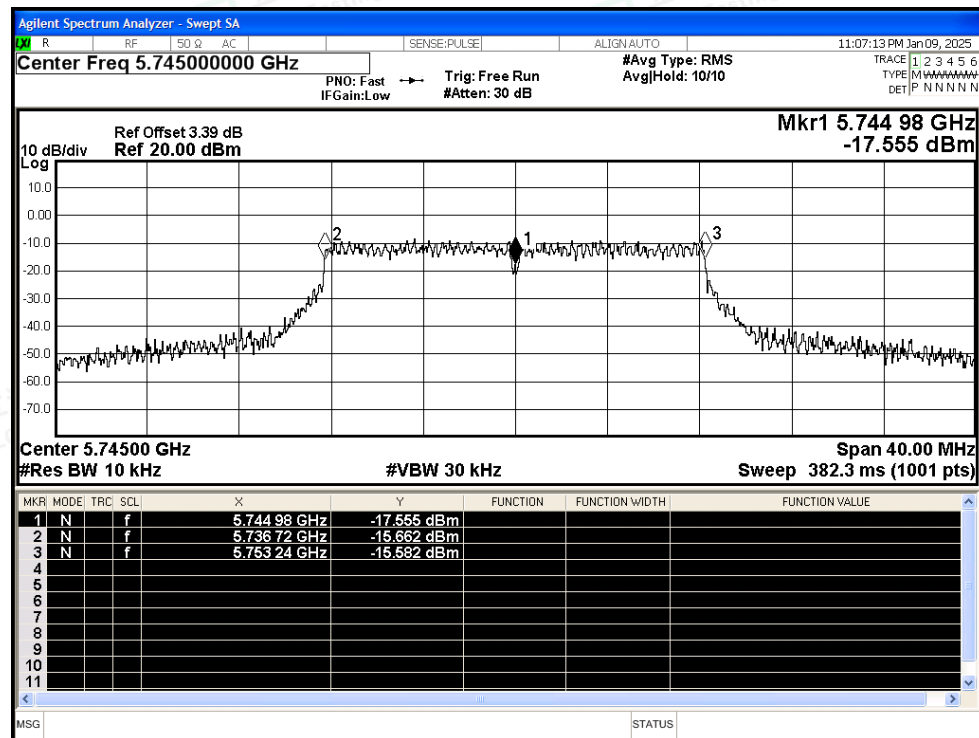

## Freq. Stability NVNT a 5785MHz Ant1


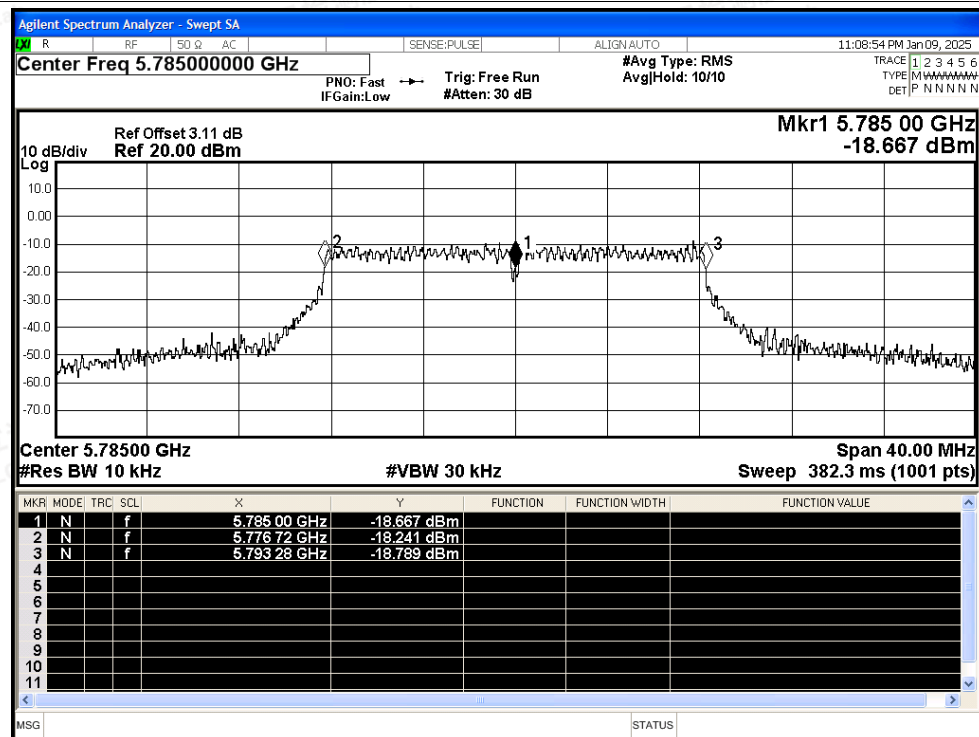


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

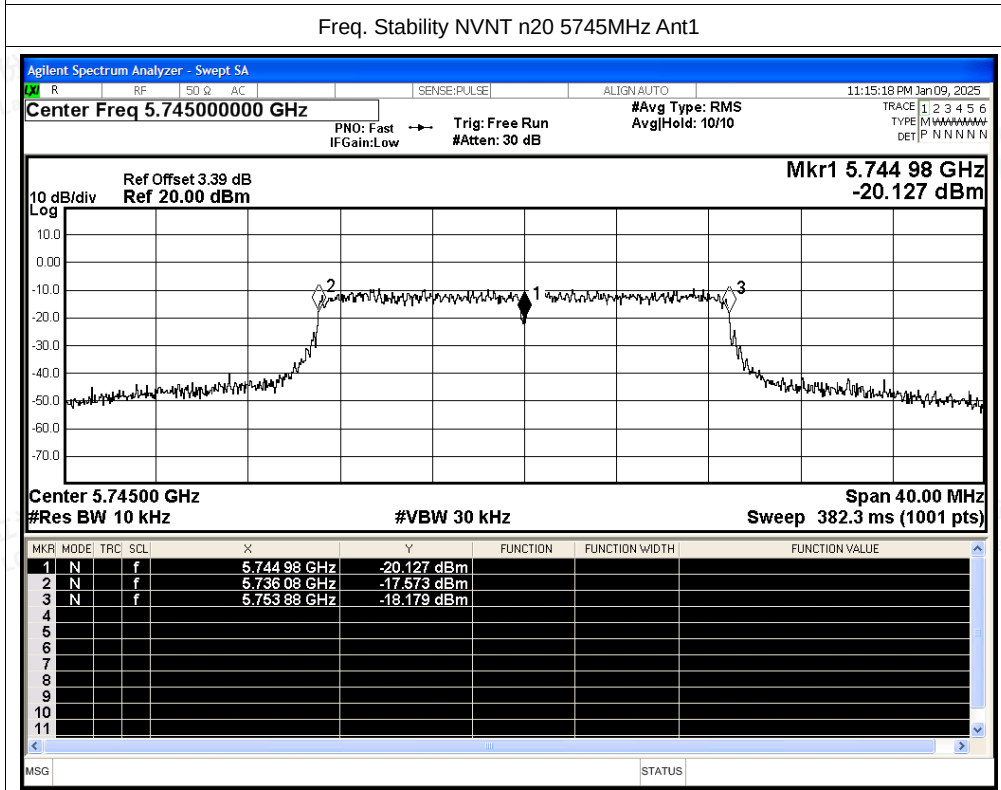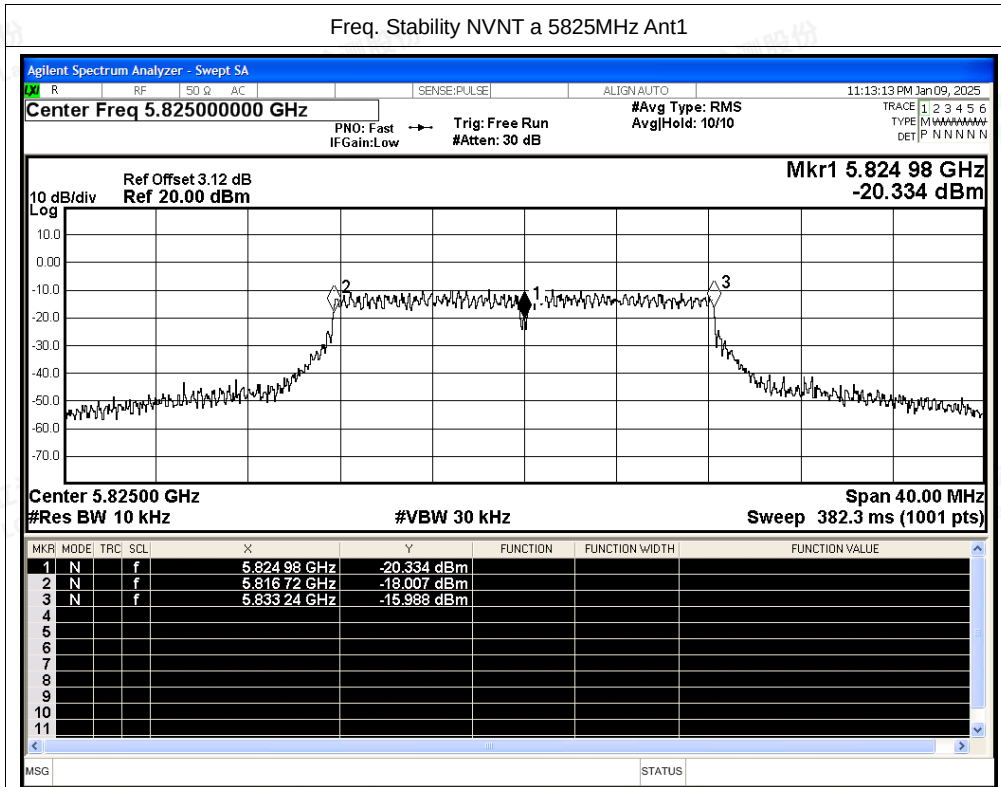

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n20 5785MHz Ant1

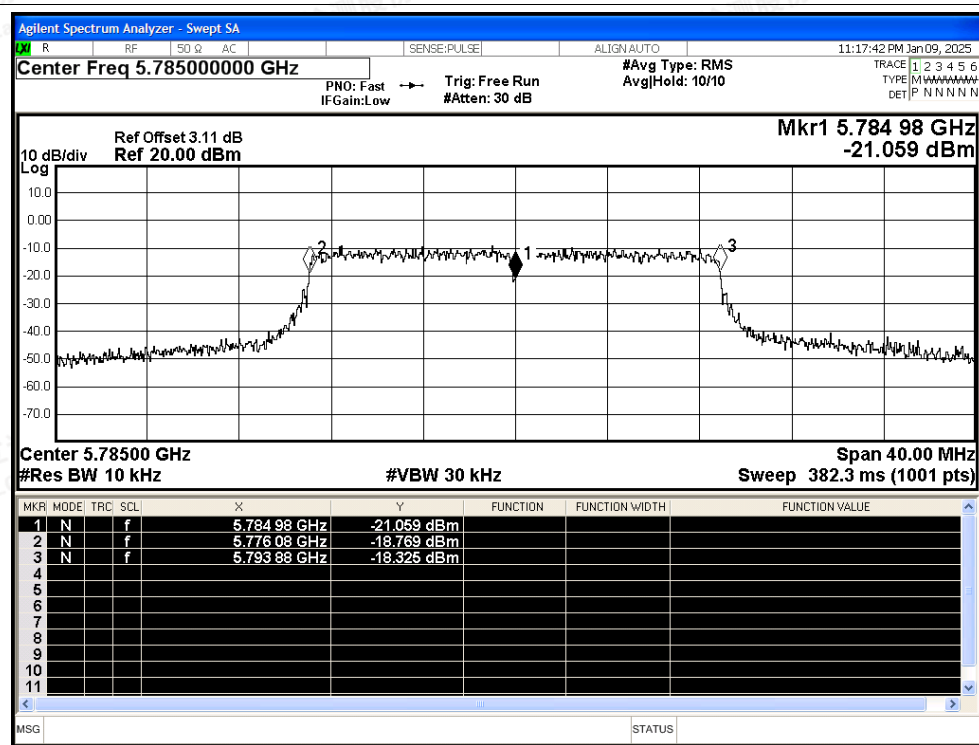

## Freq. Stability NVNT n20 5825MHz Ant1

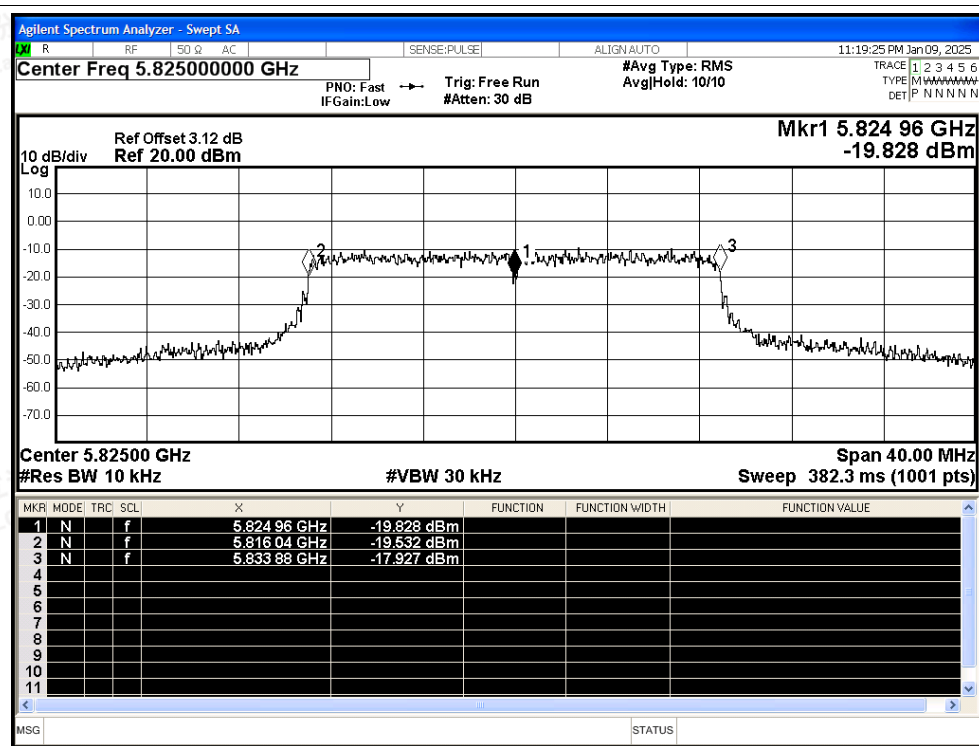

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5755MHz Ant1

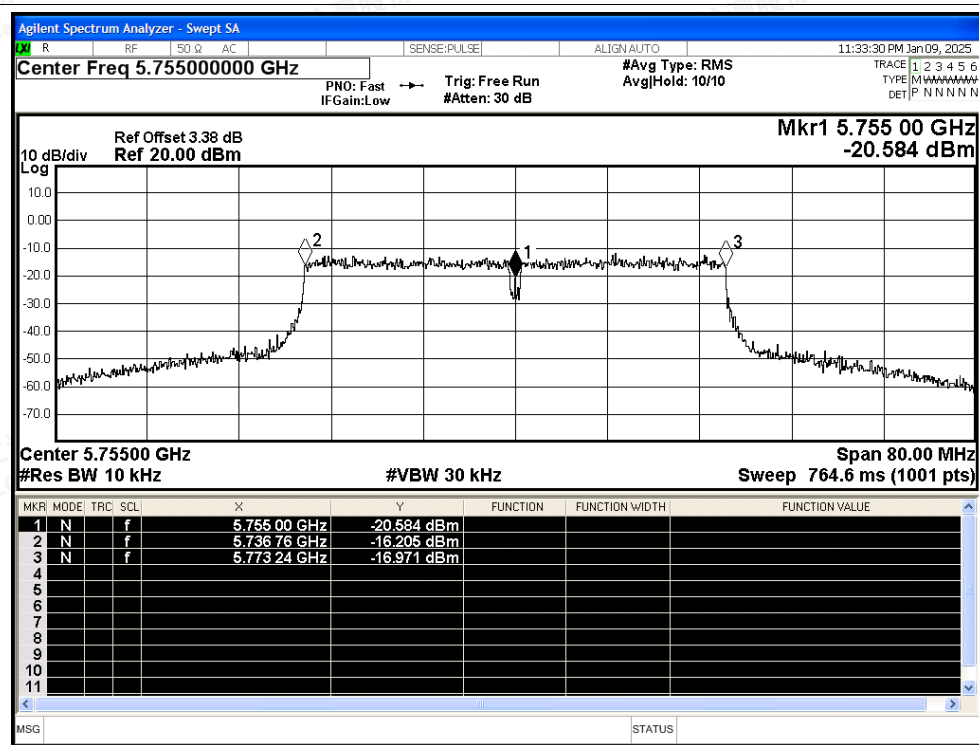

## Freq. Stability NVNT n40 5795MHz Ant1

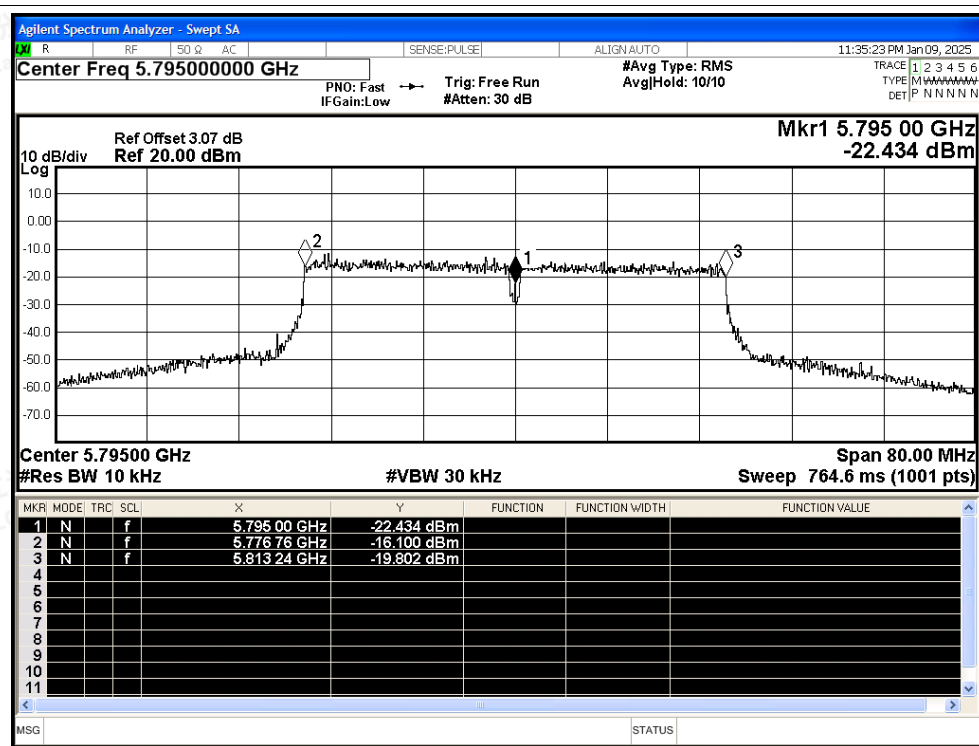

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5745MHz Ant1

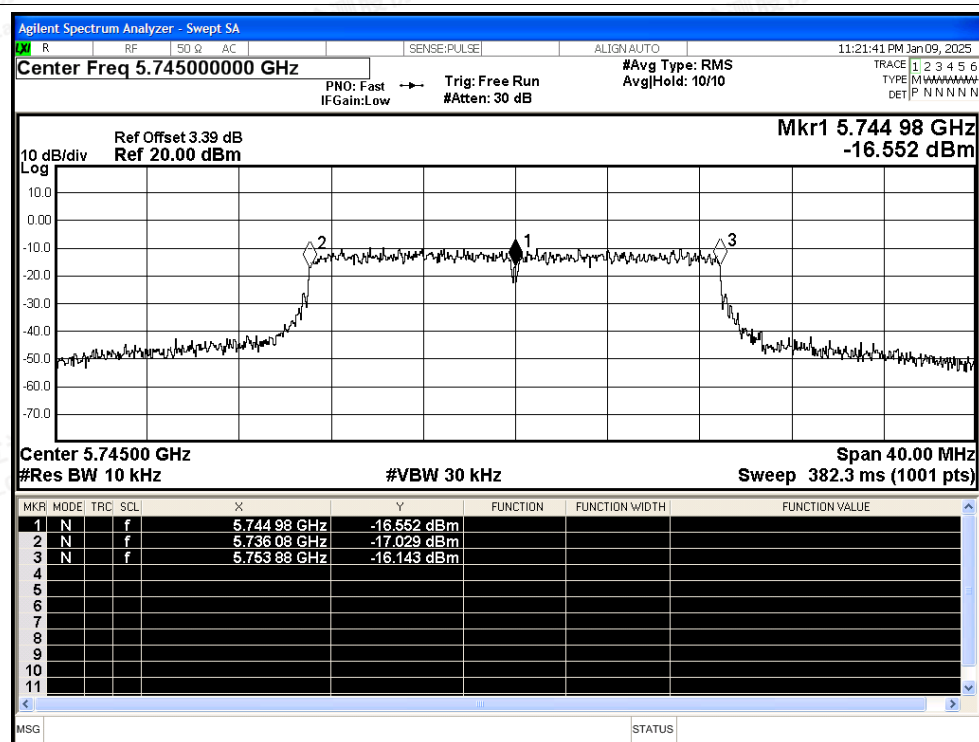

## Freq. Stability NVNT ac20 5785MHz Ant1


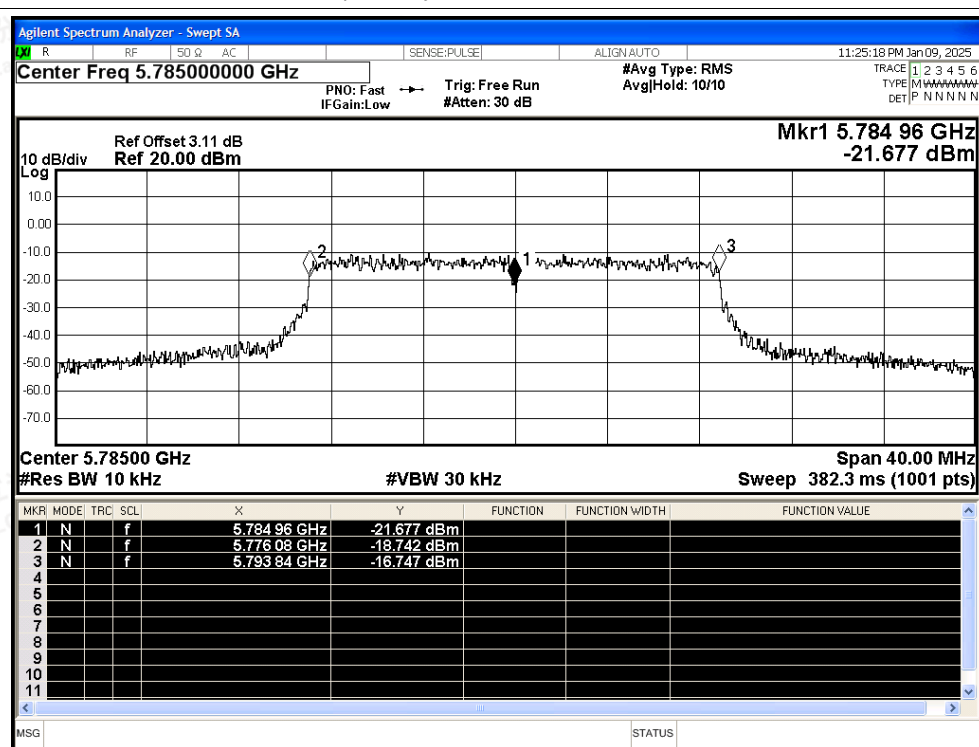


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

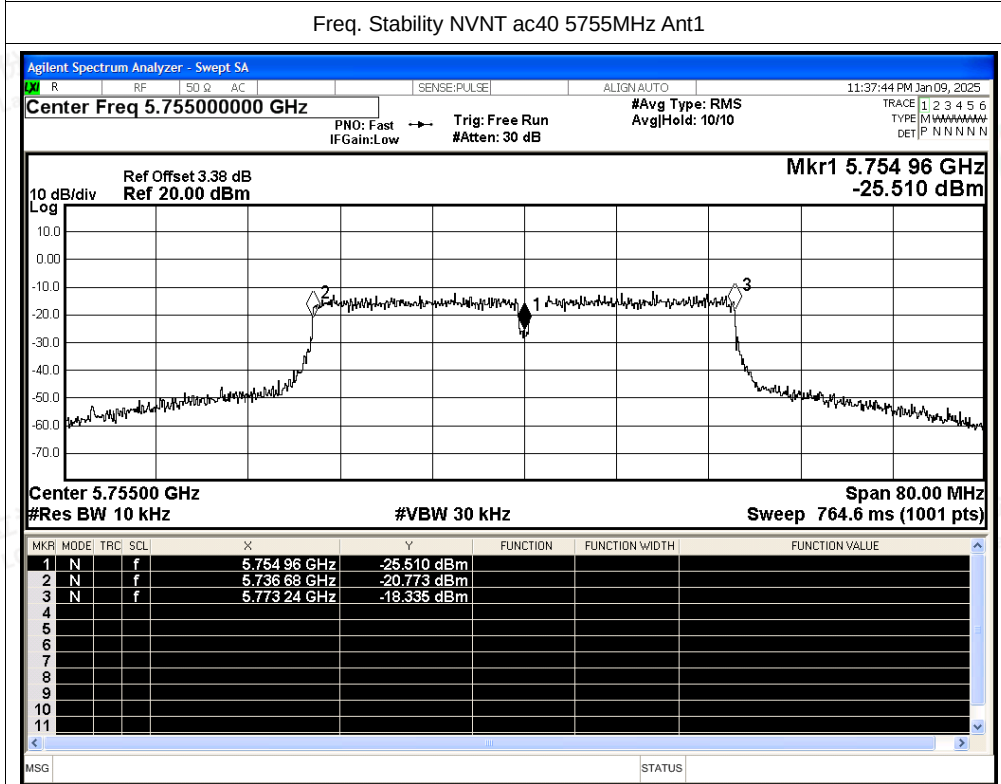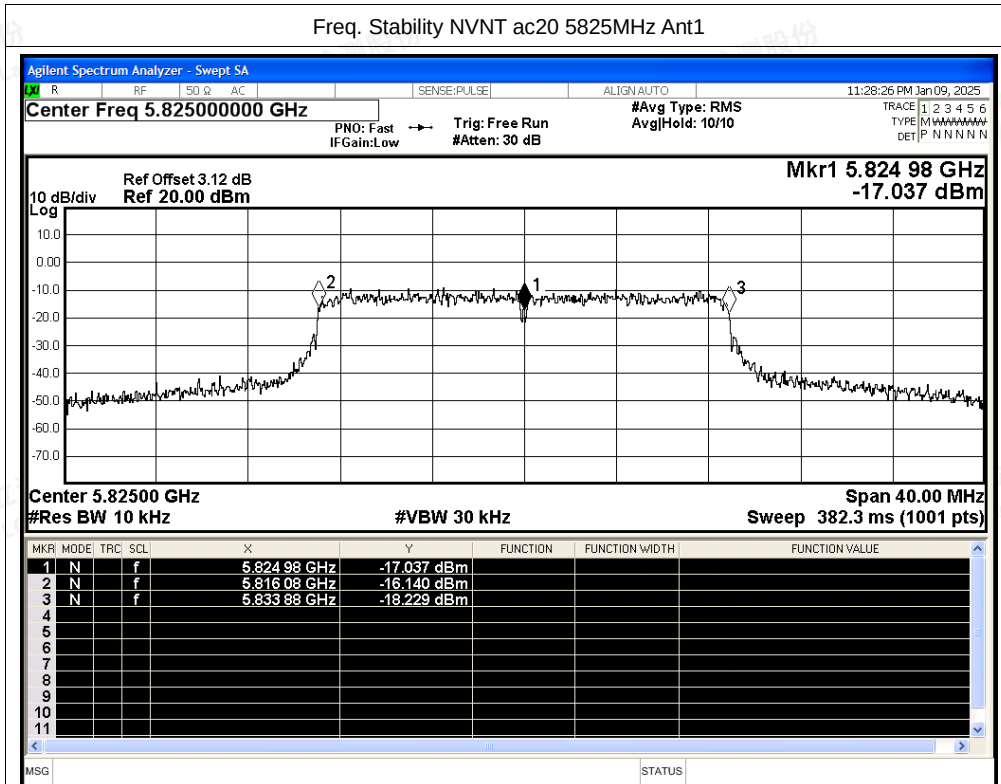

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Freq. Stability NVNT ac40 5795MHz Ant1

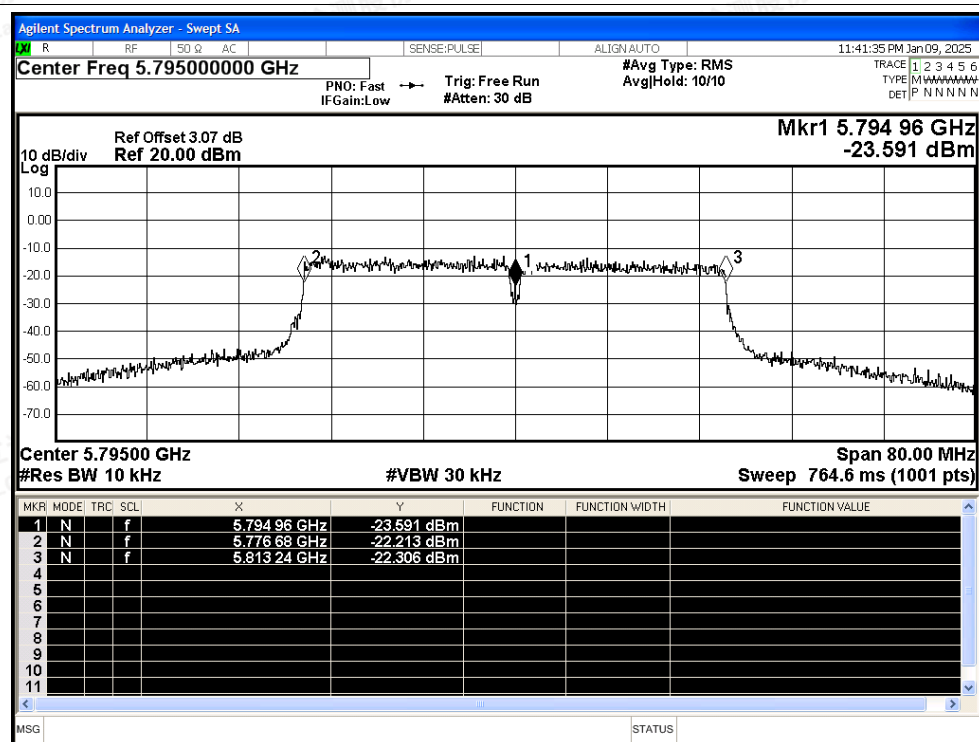

## Freq. Stability NVNT ac80 5775MHz Ant1

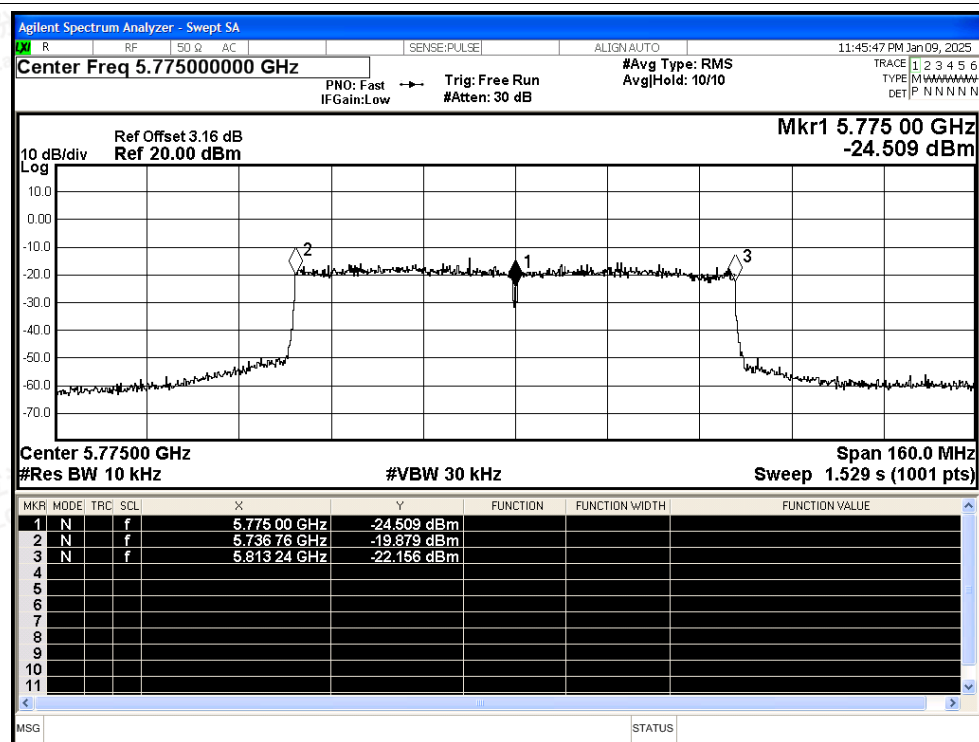

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5745MHz Ant1

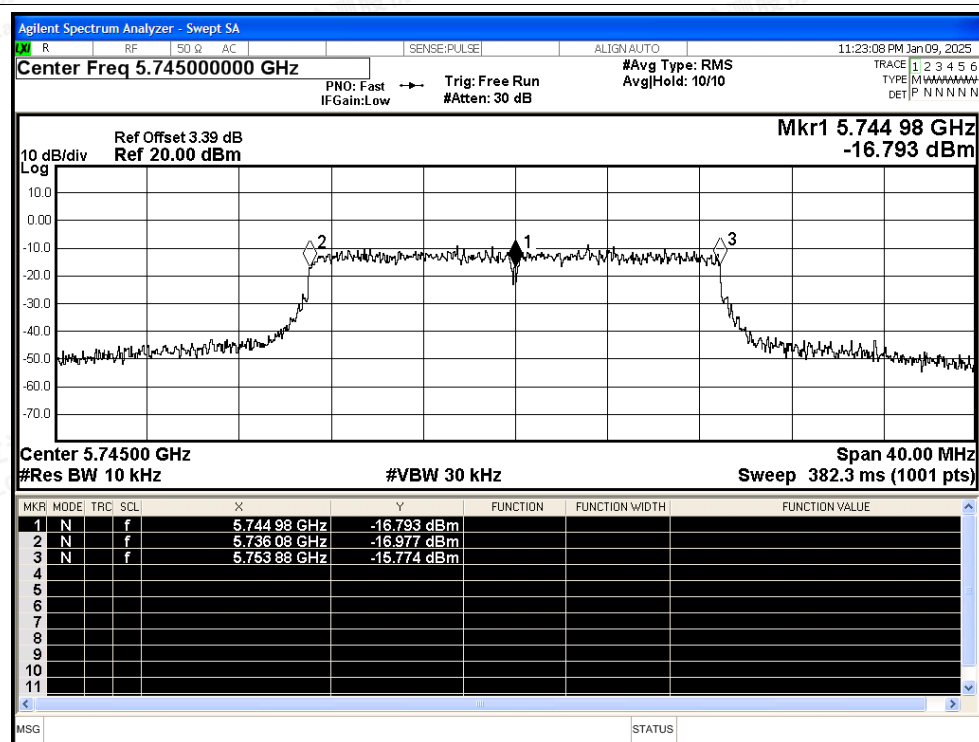

## Freq. Stability NVNT ax20 5785MHz Ant1

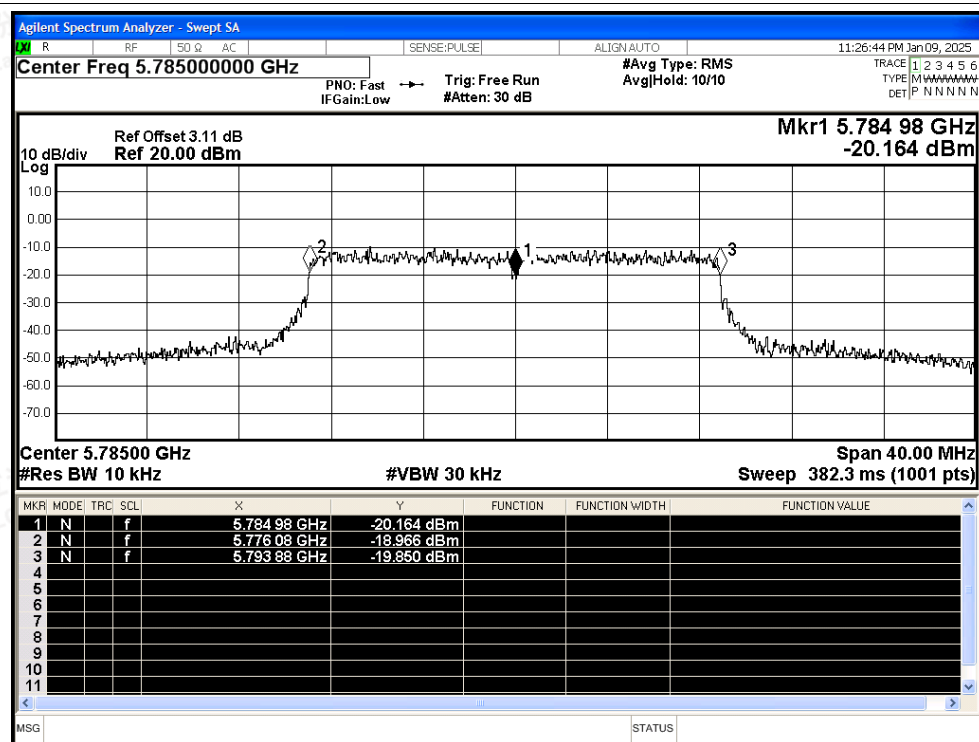

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5825MHz Ant1

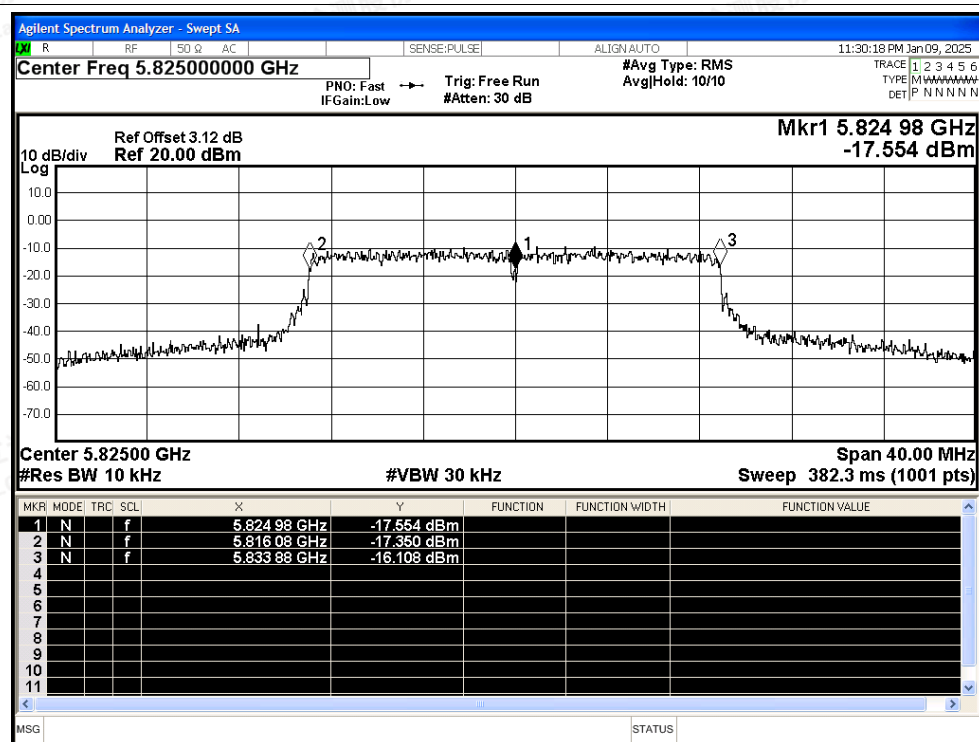

## Freq. Stability NVNT ax40 5755MHz Ant1


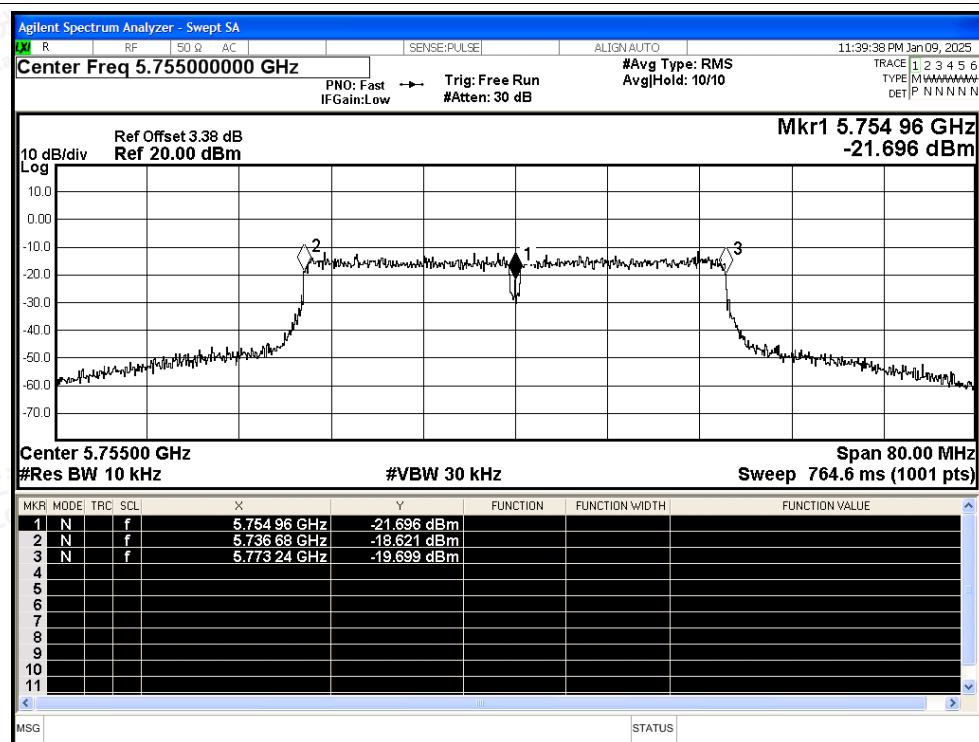


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

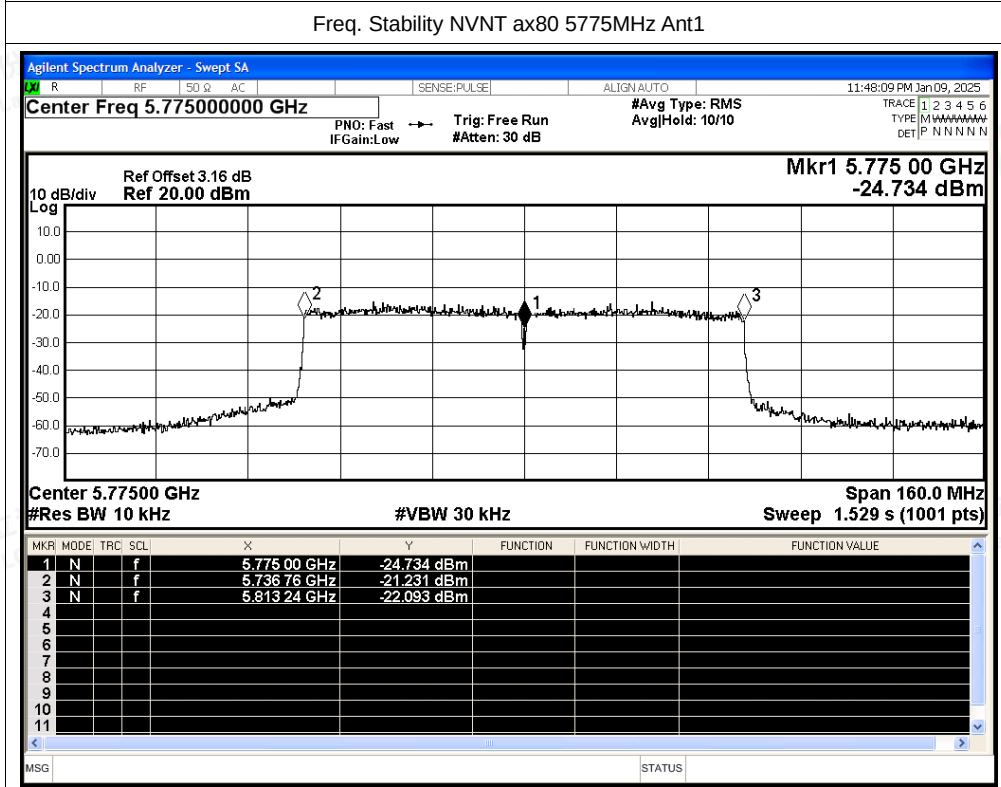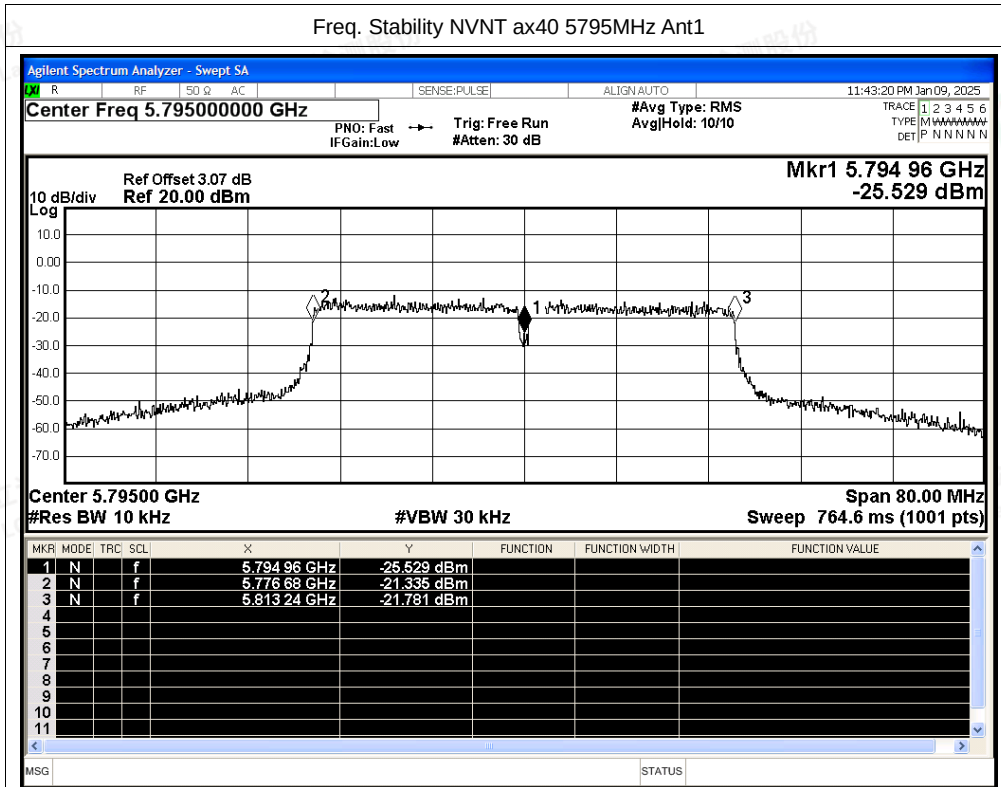

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5745            | Ant2    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | a    | 5785            | Ant2    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | a    | 5825            | Ant2    | 5824.98                  | -20000               | -3.43           | 25          | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 5744.96                  | -40000               | -6.96           | 25          | Pass    |
| NVNT      | n20  | 5785            | Ant2    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 5824.98                  | -20000               | -3.43           | 25          | Pass    |
| NVNT      | n40  | 5755            | Ant2    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | n40  | 5795            | Ant2    | 5795                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac20 | 5745            | Ant2    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ac20 | 5785            | Ant2    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | ac20 | 5825            | Ant2    | 5824.96                  | -40000               | -6.87           | 25          | Pass    |
| NVNT      | ac40 | 5755            | Ant2    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | ac40 | 5795            | Ant2    | 5795                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac80 | 5775            | Ant2    | 5775                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax20 | 5745            | Ant2    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ax20 | 5785            | Ant2    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | ax20 | 5825            | Ant2    | 5824.96                  | -40000               | -6.87           | 25          | Pass    |
| NVNT      | ax40 | 5755            | Ant2    | 5755                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ax40 | 5795            | Ant2    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ax80 | 5775            | Ant2    | 5775                     | 0                    | 0               | 25          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Freq. Stability NVNT a 5745MHz Ant2

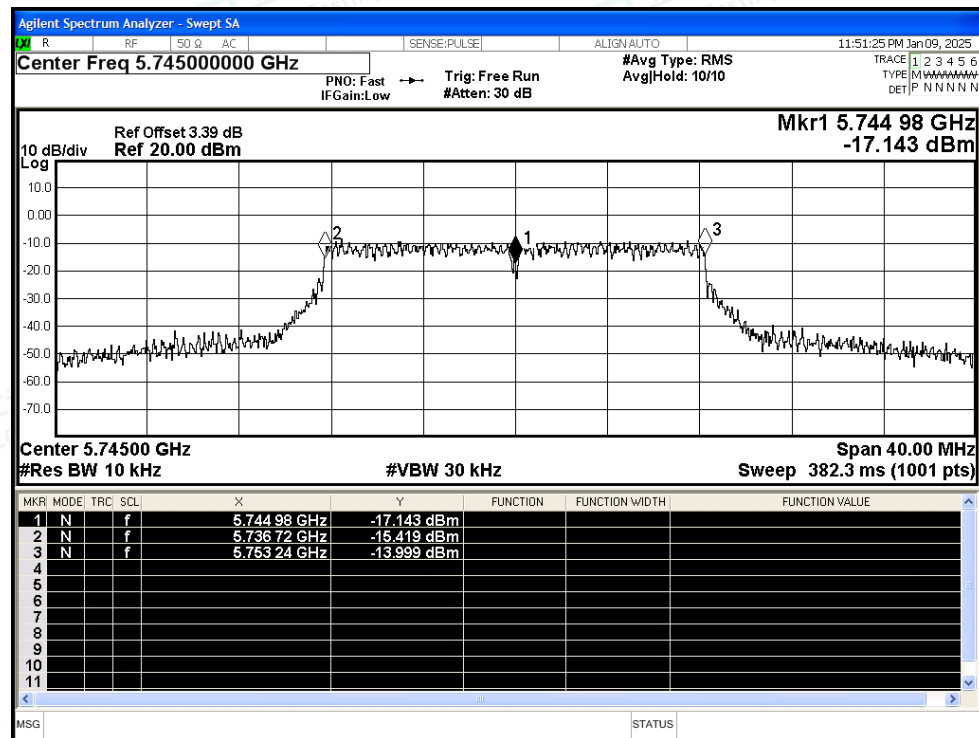

## Freq. Stability NVNT a 5785MHz Ant2

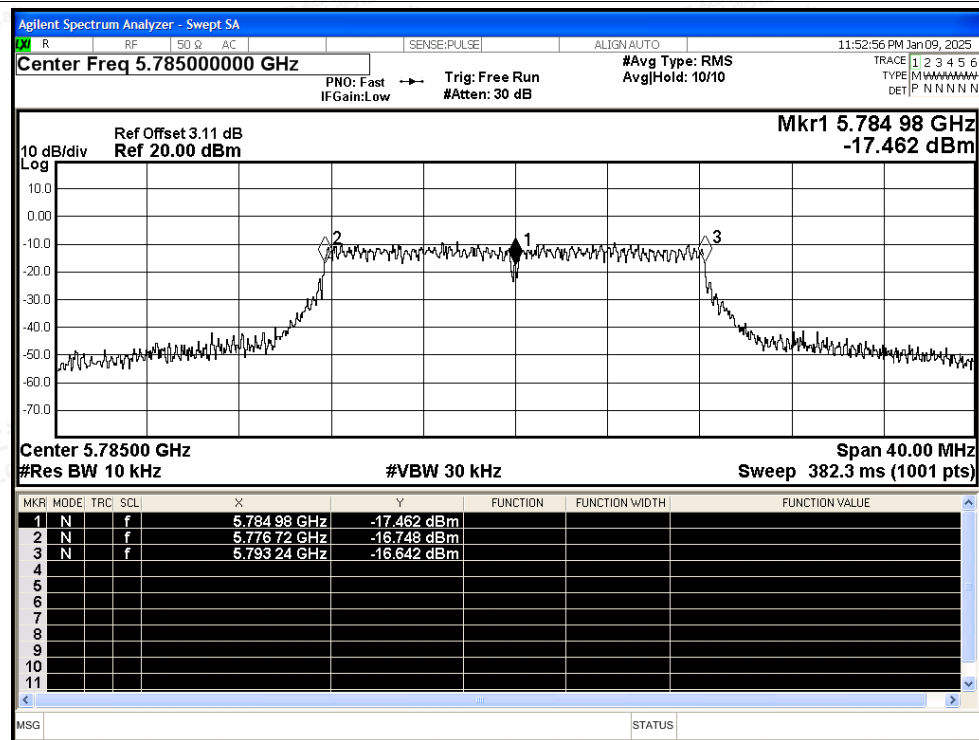



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



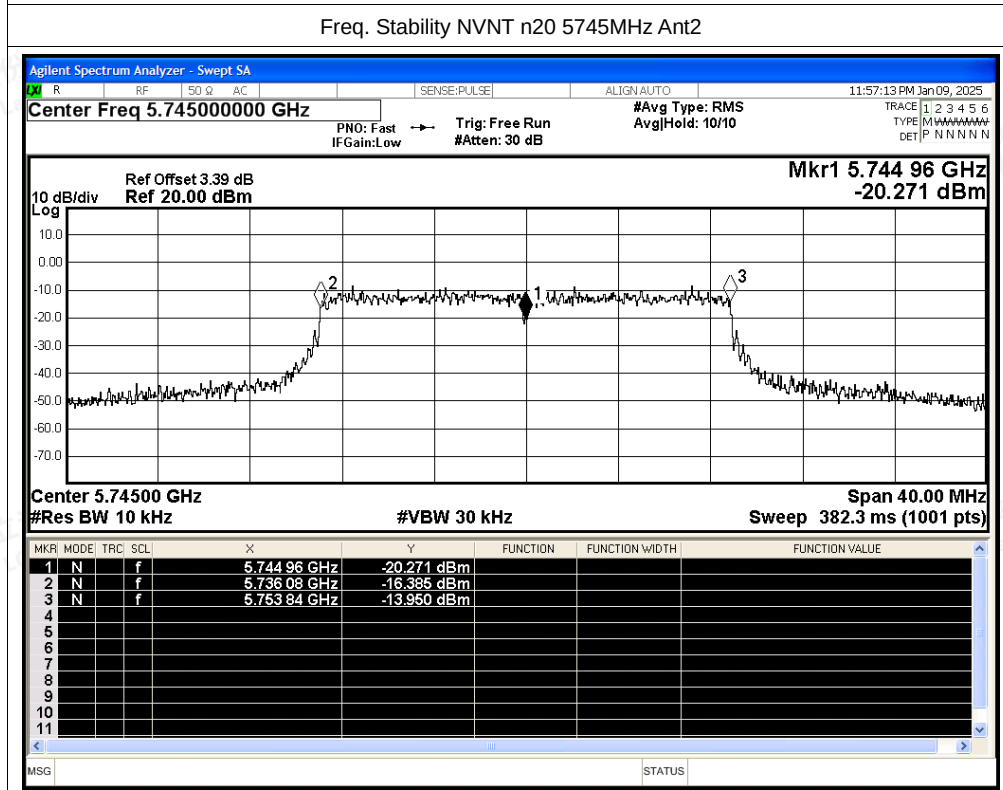
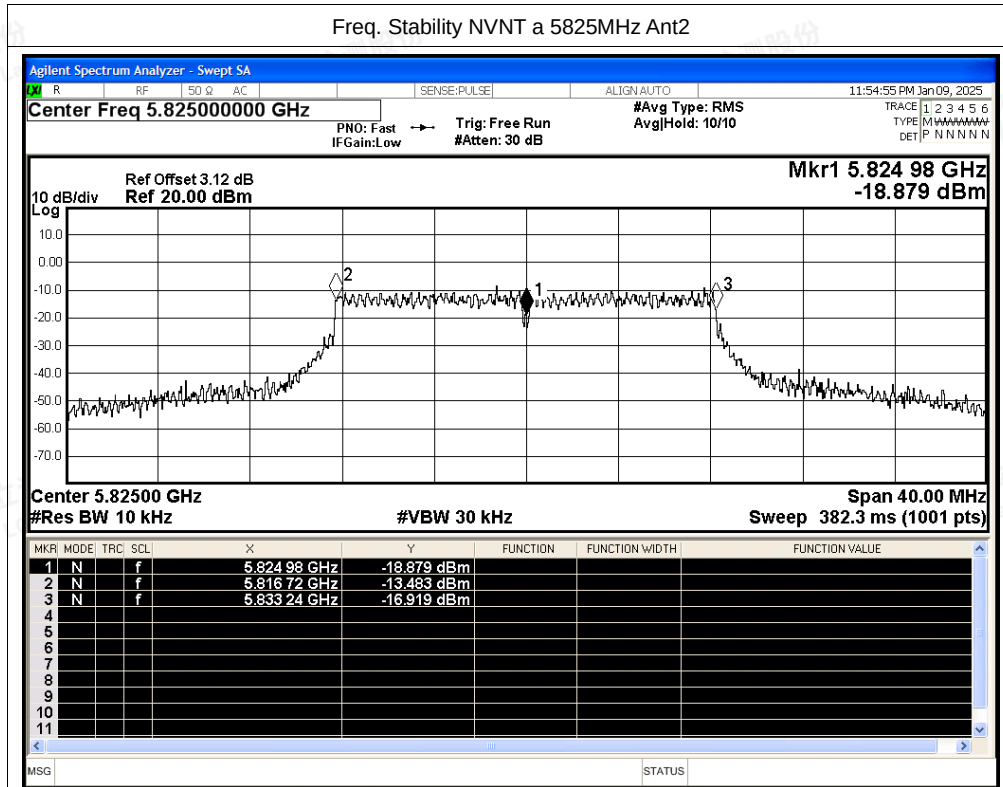


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

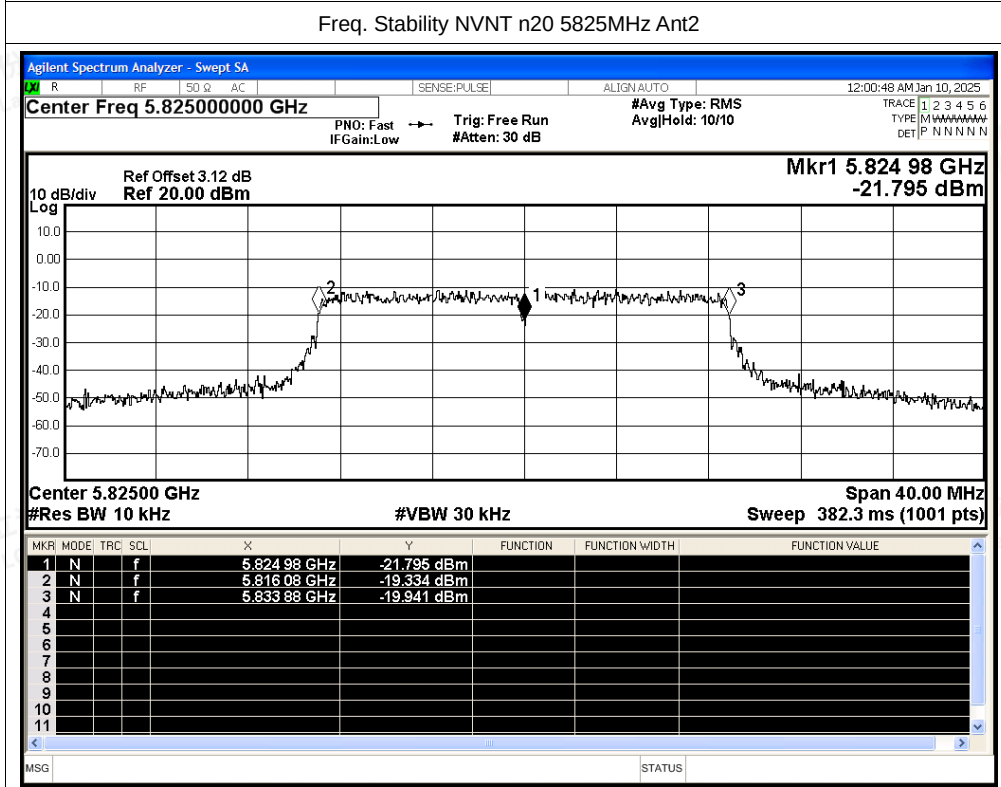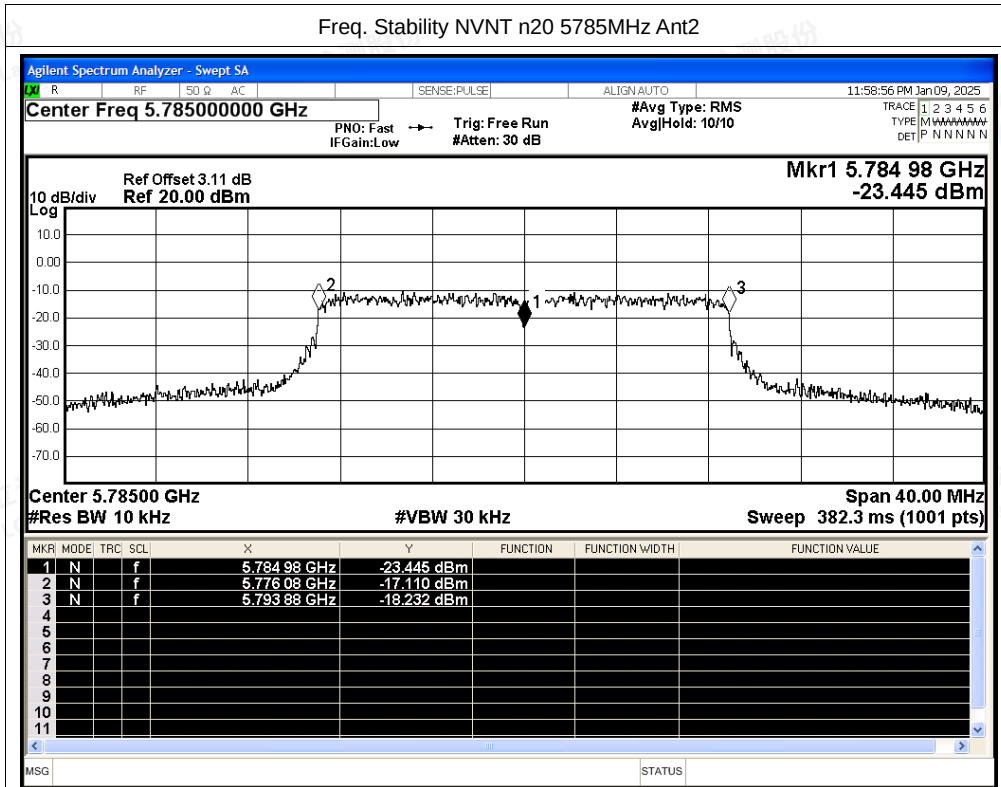

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5755MHz Ant2

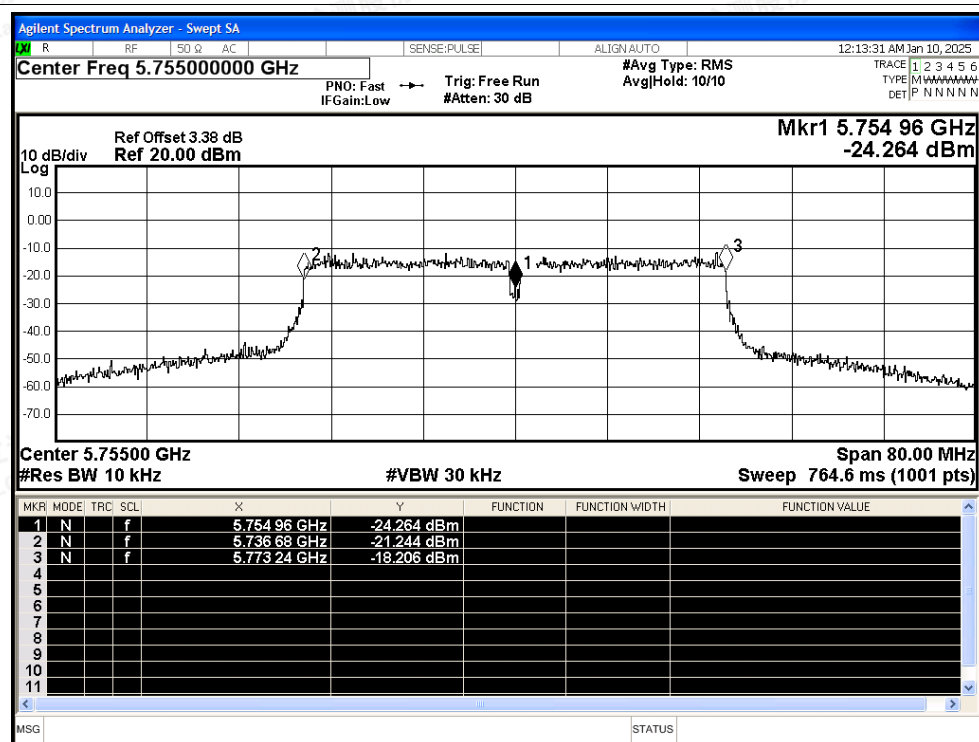

## Freq. Stability NVNT n40 5795MHz Ant2


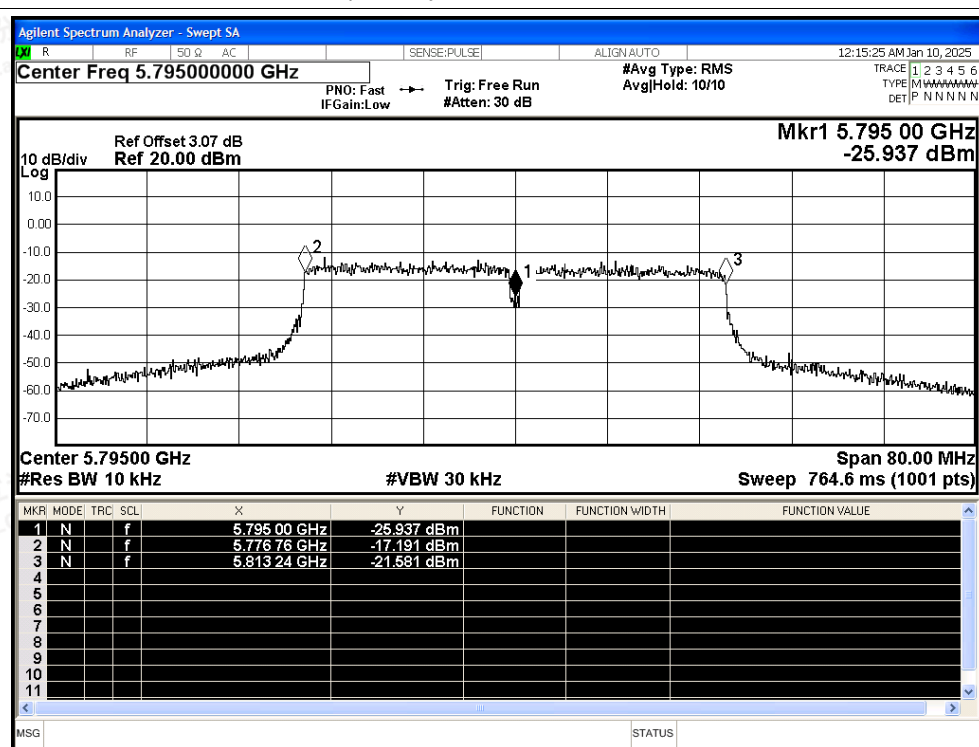


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

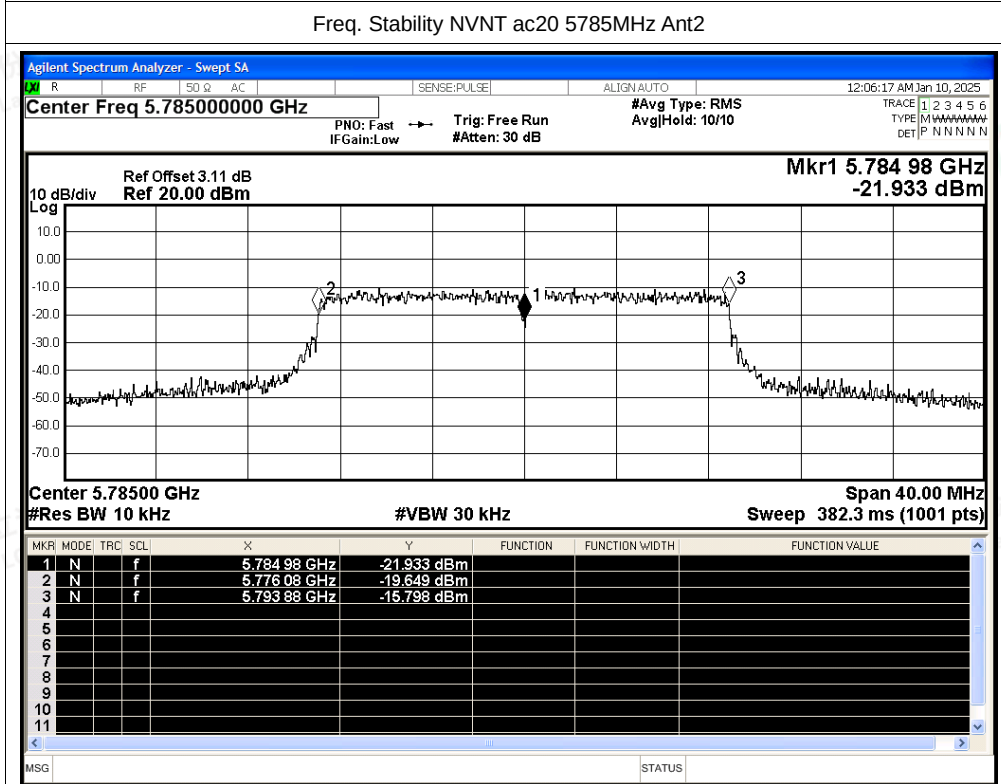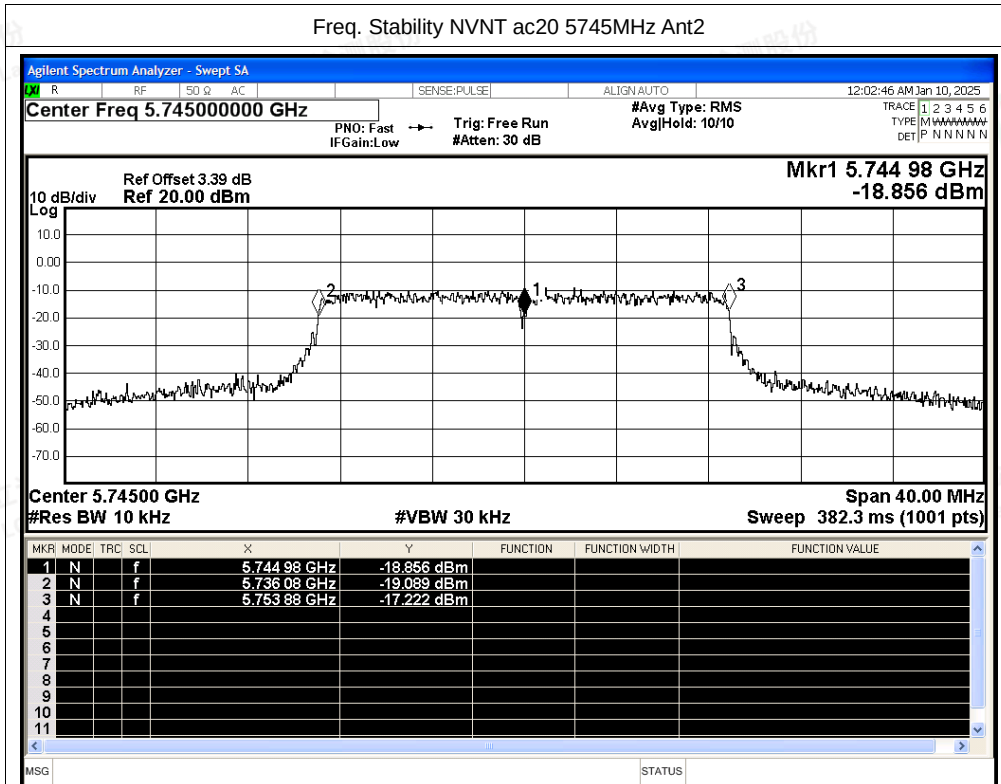

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5825MHz Ant2

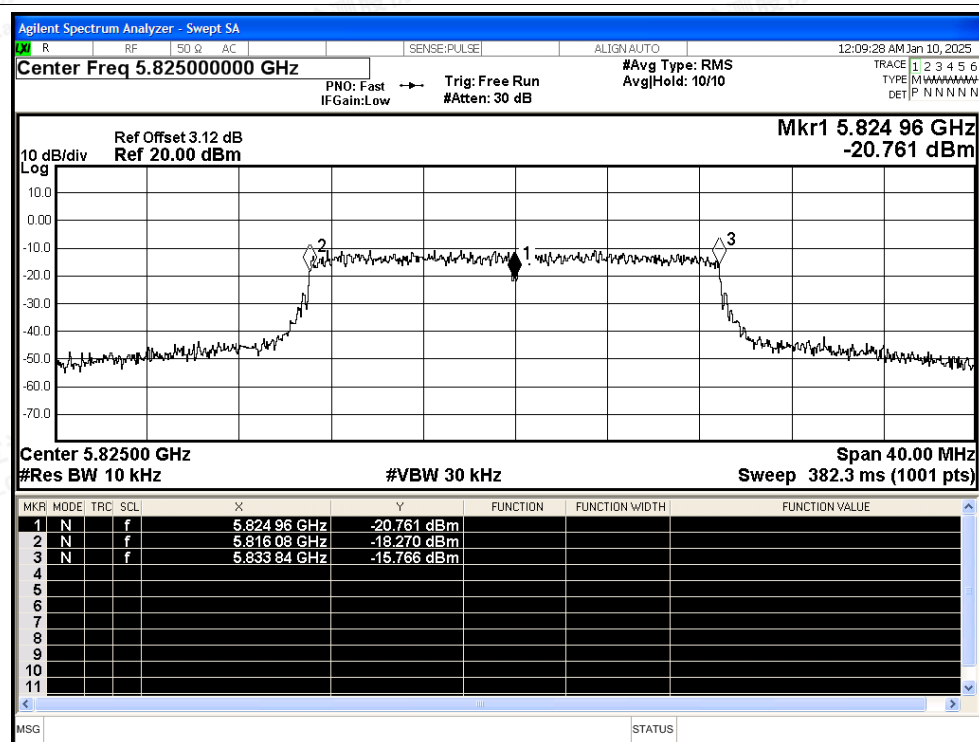

## Freq. Stability NVNT ac40 5755MHz Ant2


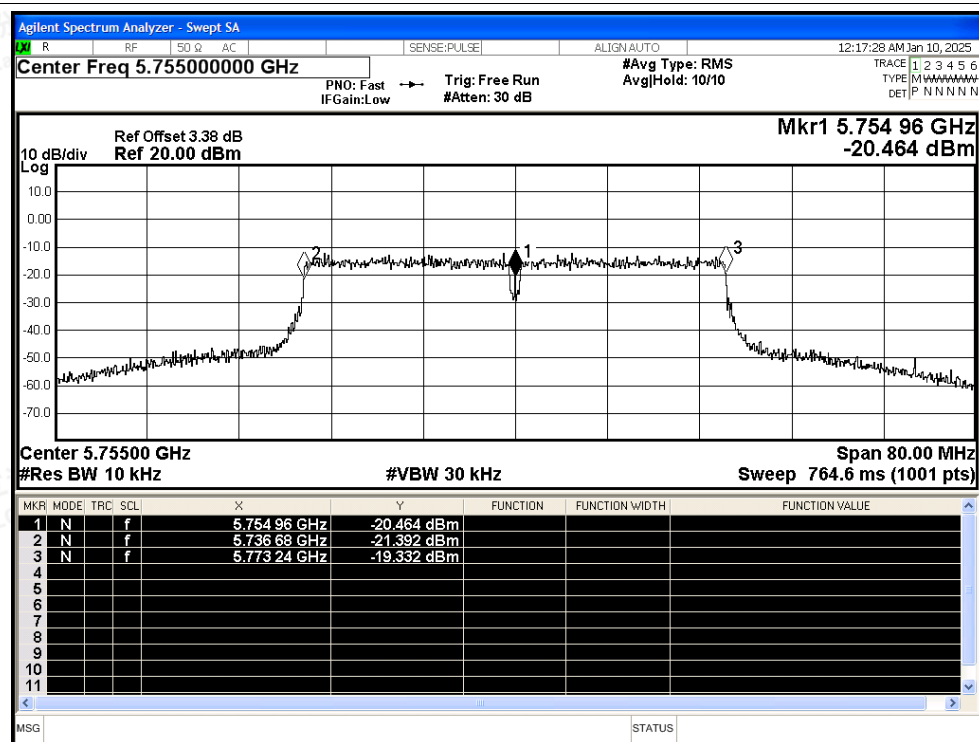


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

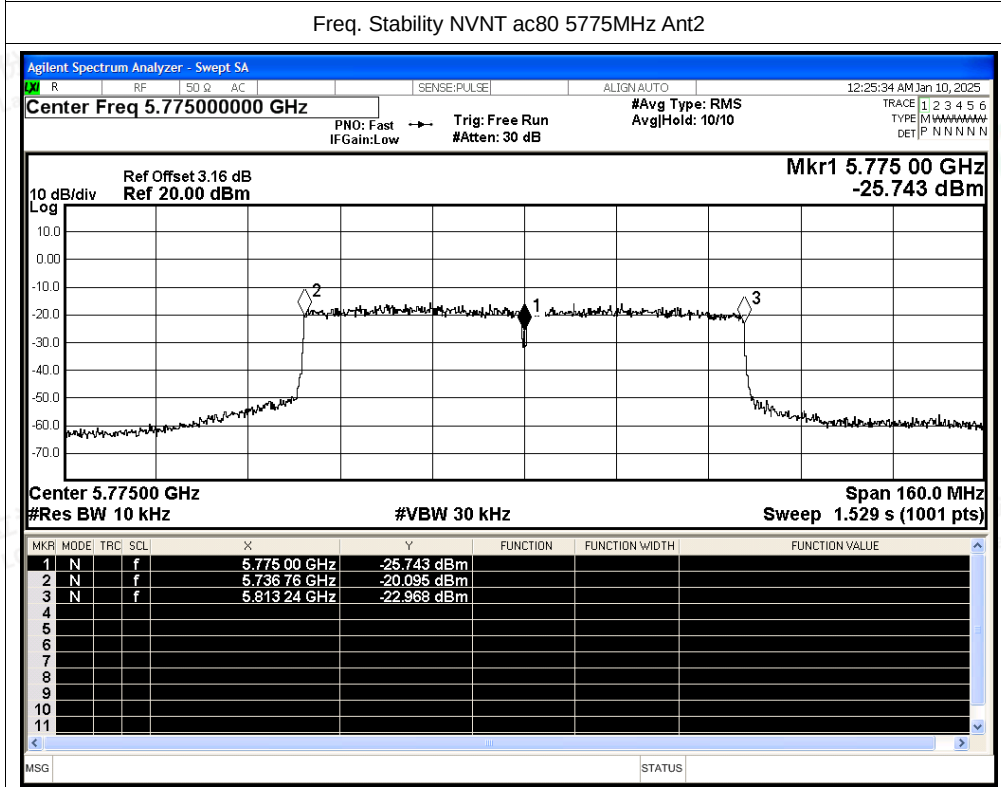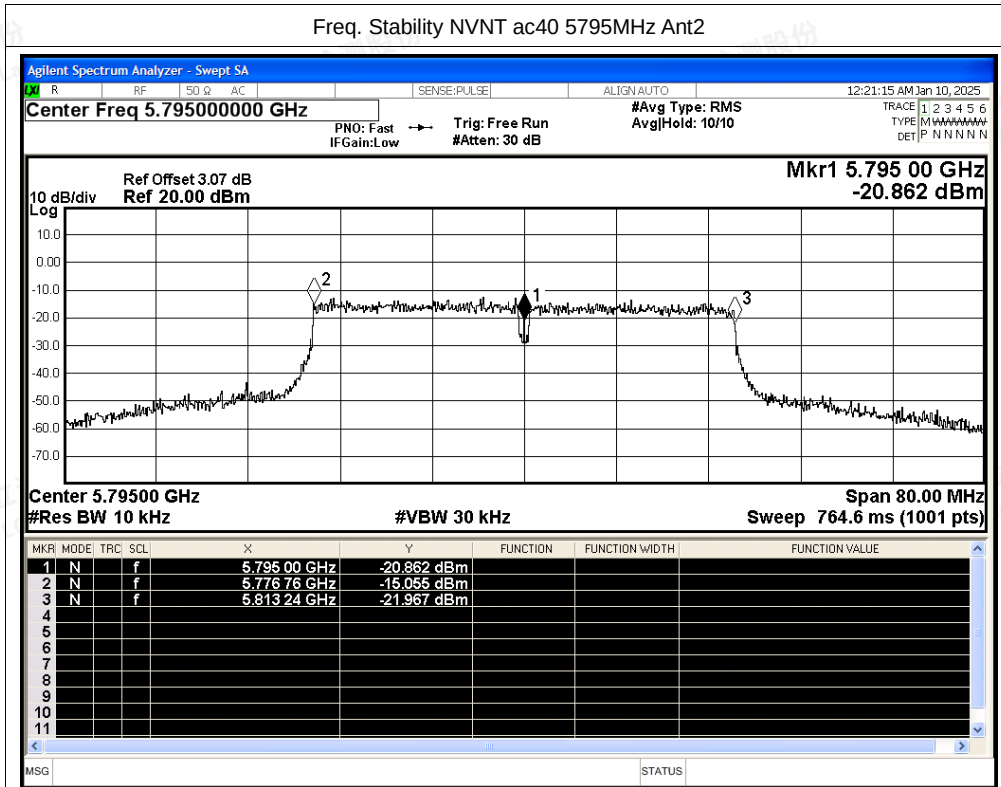

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Freq. Stability NVNT ax20 5745MHz Ant2

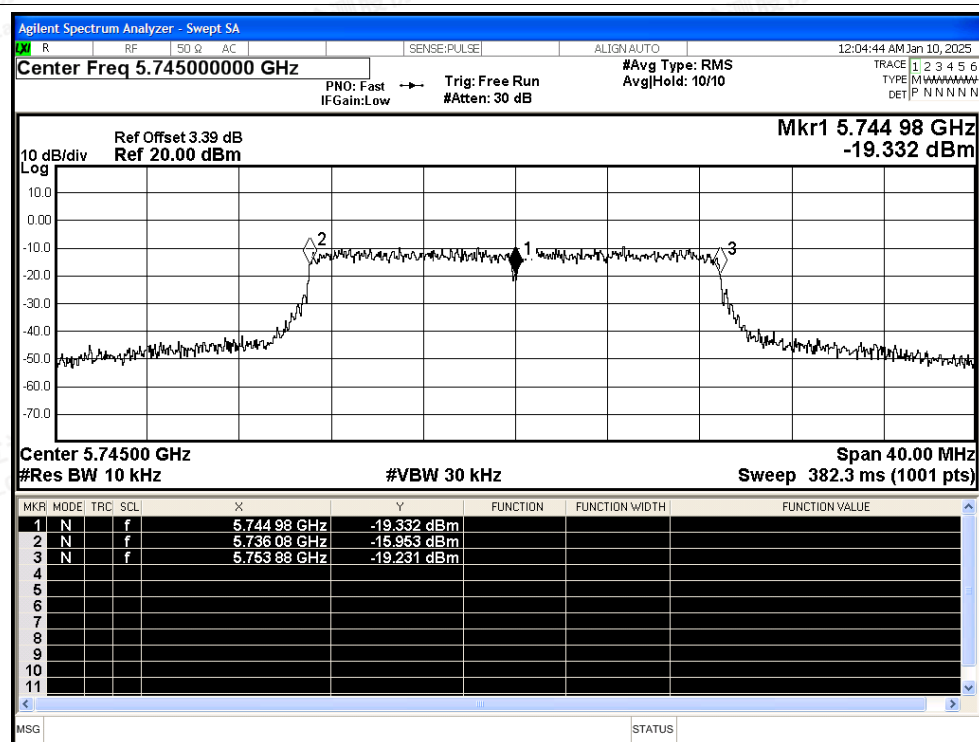

## Freq. Stability NVNT ax20 5785MHz Ant2

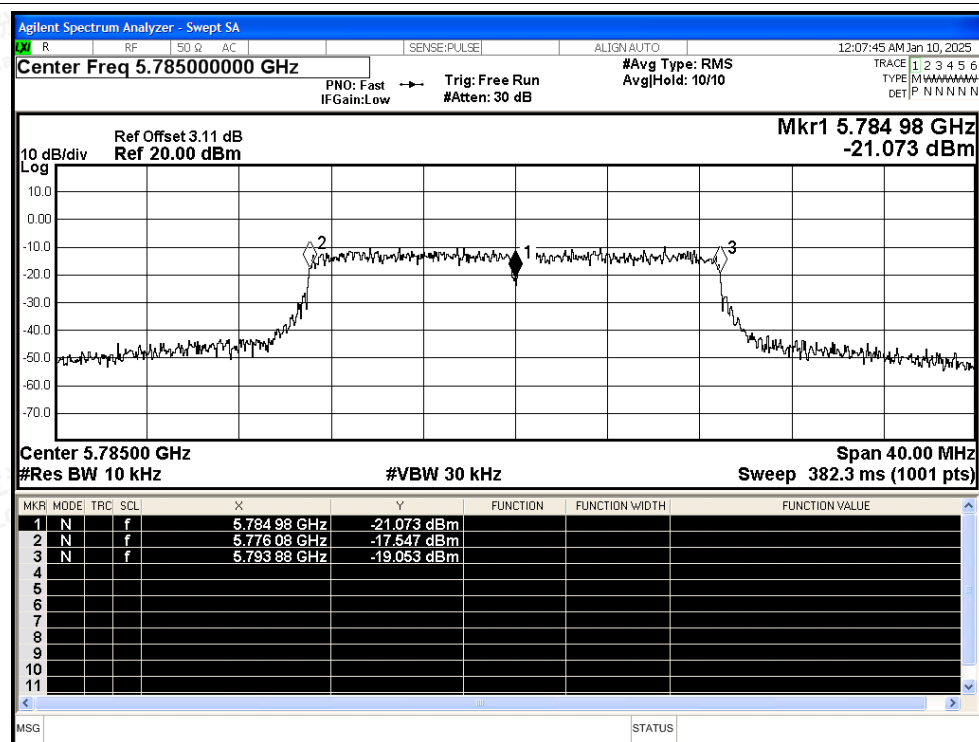

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5825MHz Ant2

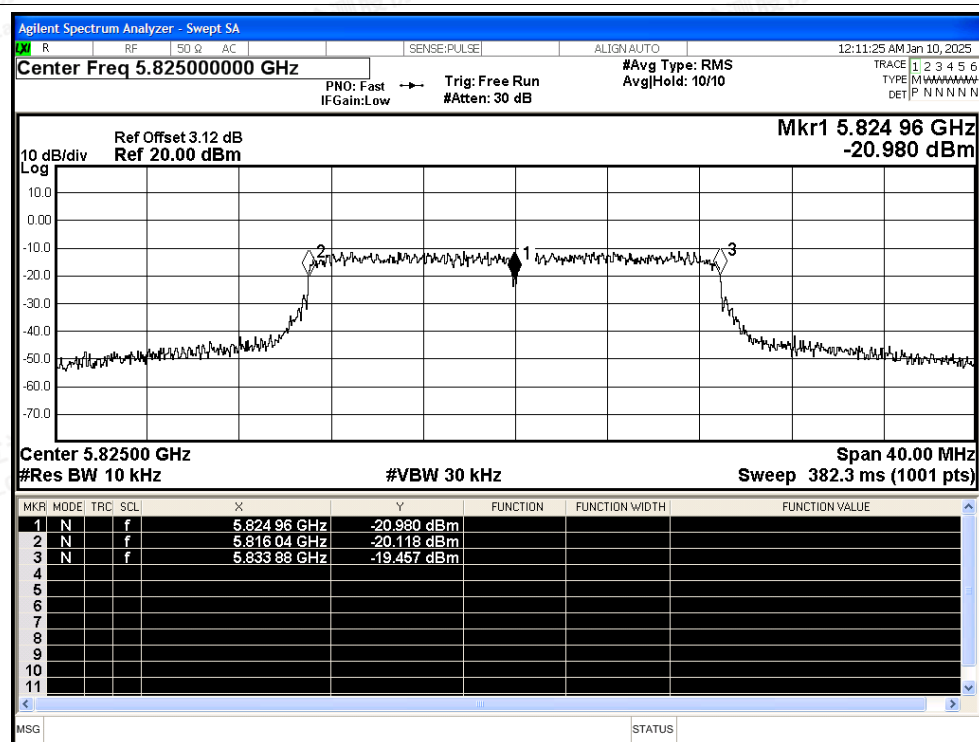

## Freq. Stability NVNT ax40 5755MHz Ant2


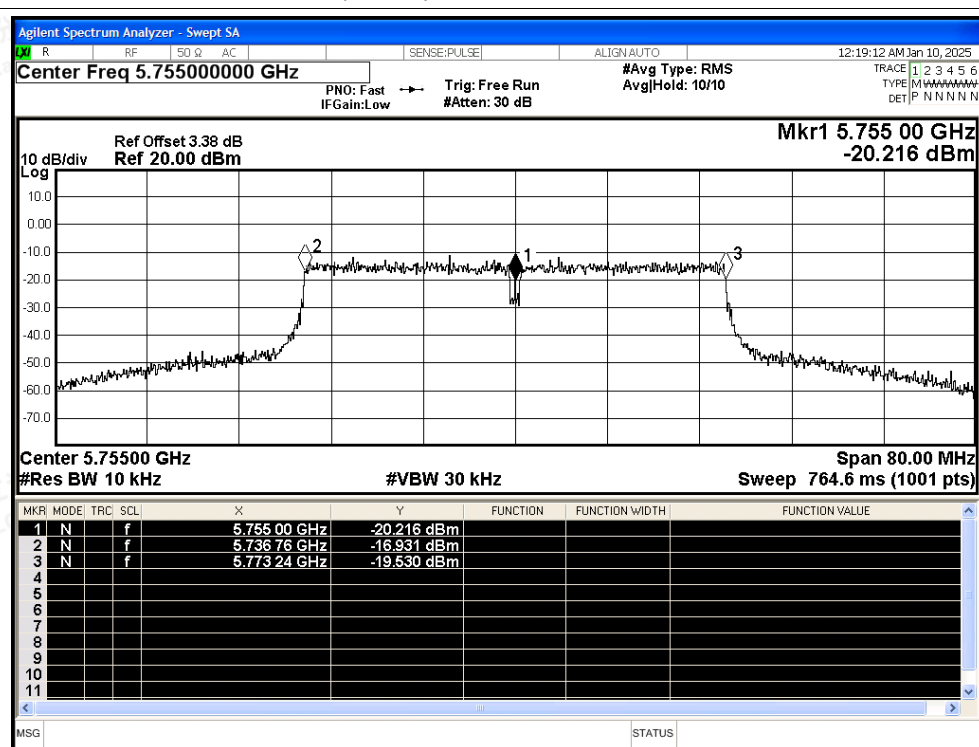


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

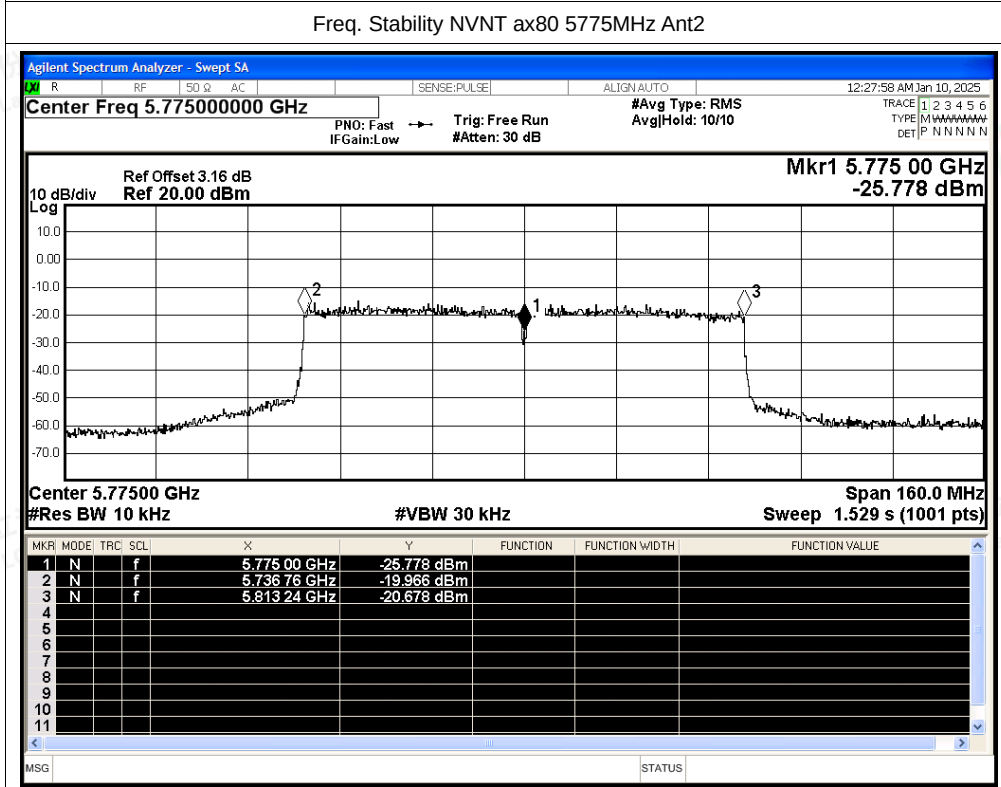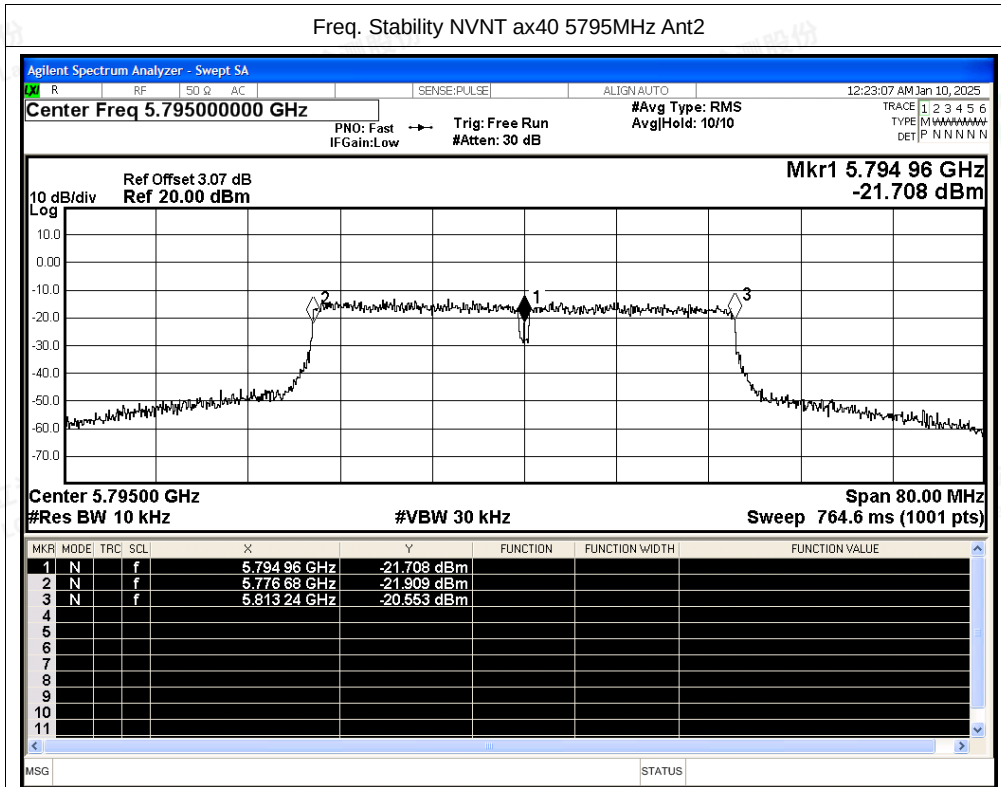

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## F.6 Duty Cycle

| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5785            | Ant1    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5825            | Ant1    | 94.65          | 0.24                   | 0.91      |
| NVNT      | n20  | 5745            | Ant1    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20  | 5785            | Ant1    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20  | 5825            | Ant1    | 97.33          | 0.12                   | 0.44      |
| NVNT      | n40  | 5755            | Ant1    | 94.71          | 0.24                   | 0.9       |
| NVNT      | n40  | 5795            | Ant1    | 94.71          | 0.24                   | 0.9       |
| NVNT      | ac20 | 5745            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac20 | 5785            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac20 | 5825            | Ant1    | 97.3           | 0.12                   | 0.44      |
| NVNT      | ac40 | 5755            | Ant1    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ac40 | 5795            | Ant1    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ac80 | 5775            | Ant1    | 94.32          | 0.25                   | 0.97      |
| NVNT      | ax20 | 5745            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20 | 5785            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20 | 5825            | Ant1    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax40 | 5755            | Ant1    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ax40 | 5795            | Ant1    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ax80 | 5775            | Ant1    | 94.41          | 0.25                   | 0.97      |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Duty Cycle NVNT a 5745MHz Ant1

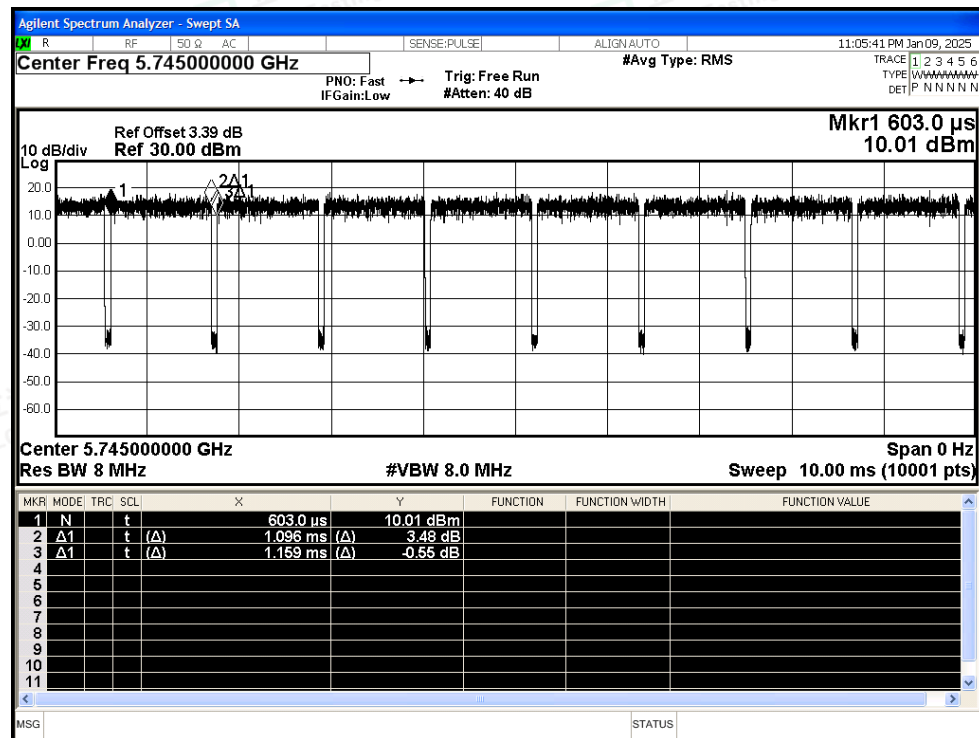

## Duty Cycle NVNT a 5785MHz Ant1


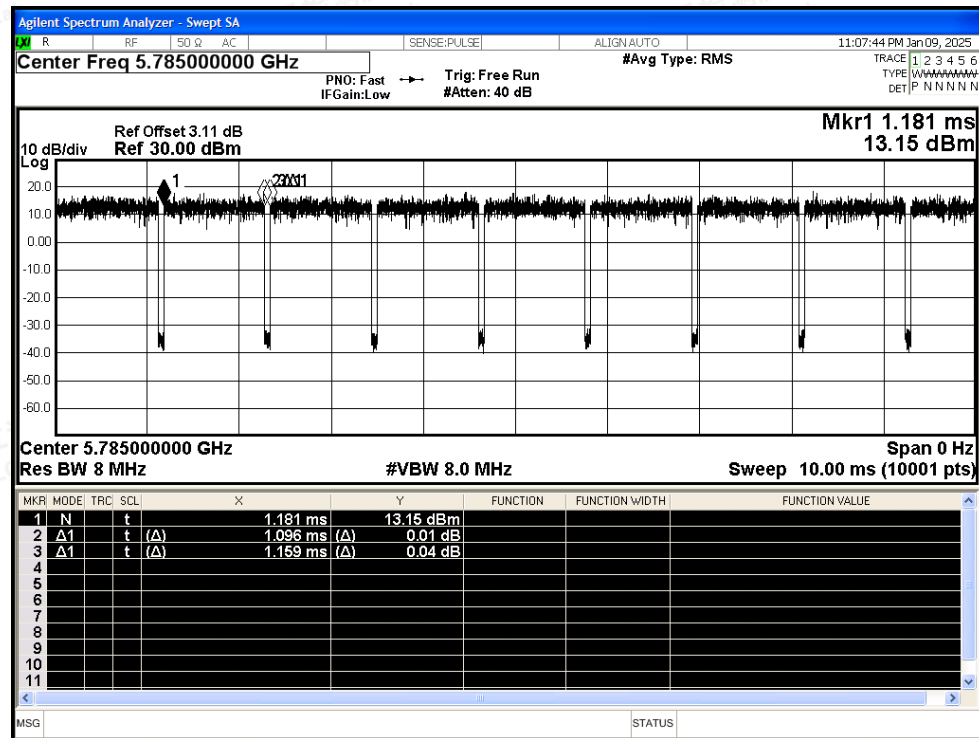


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

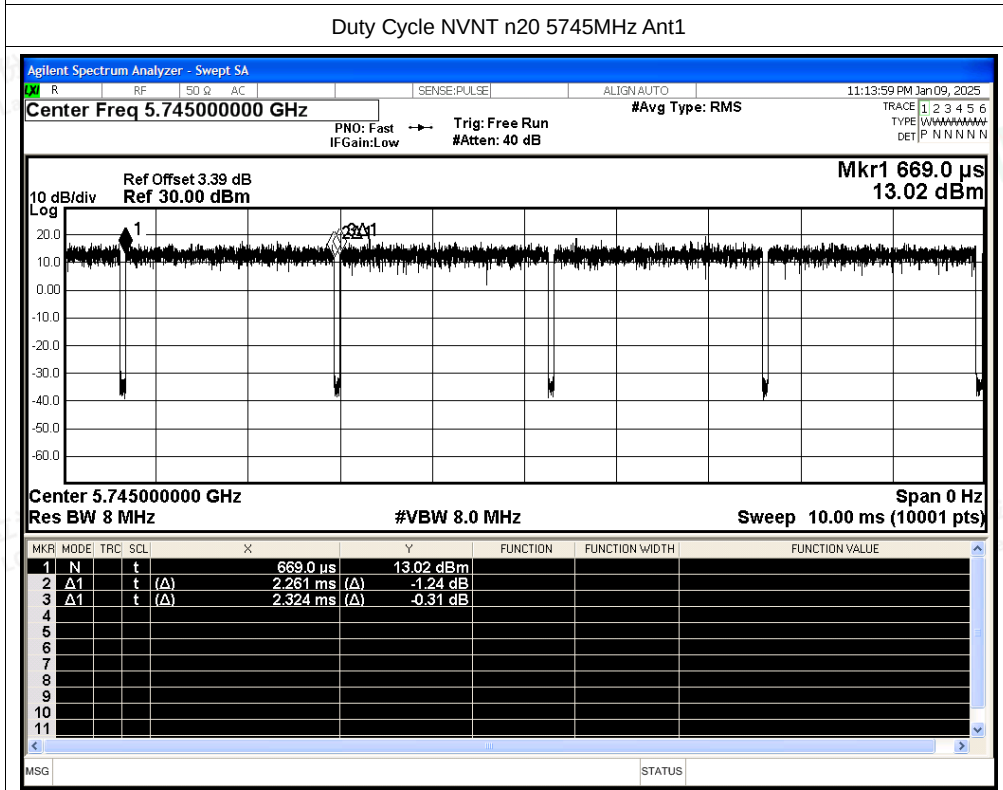
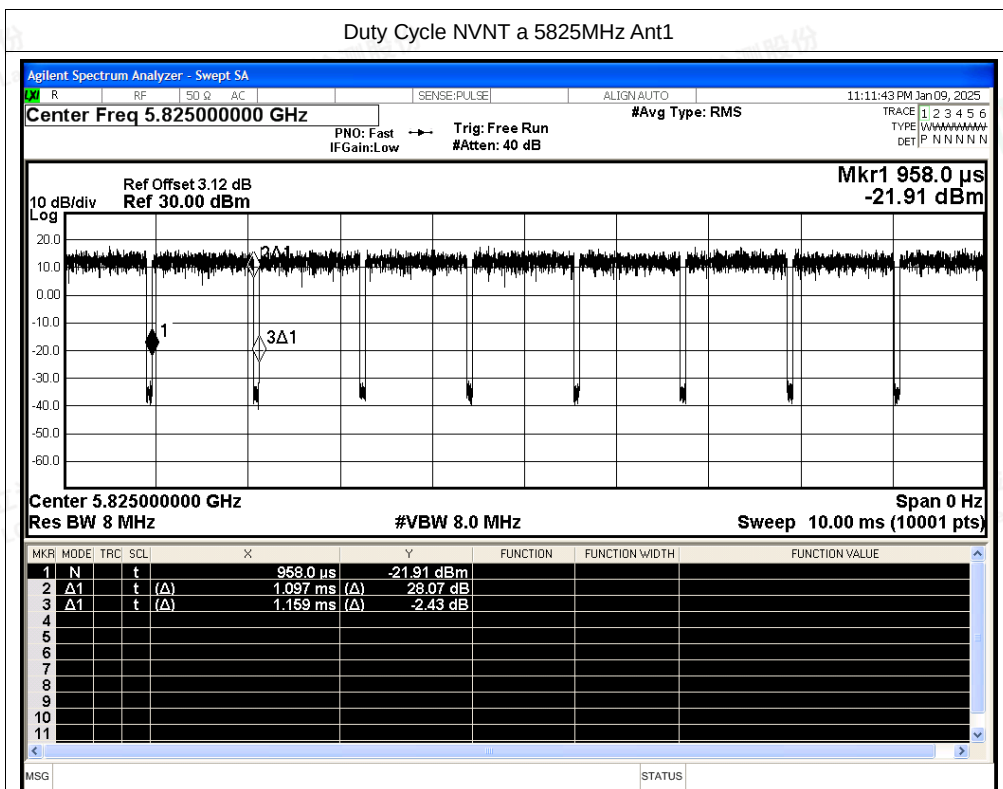


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

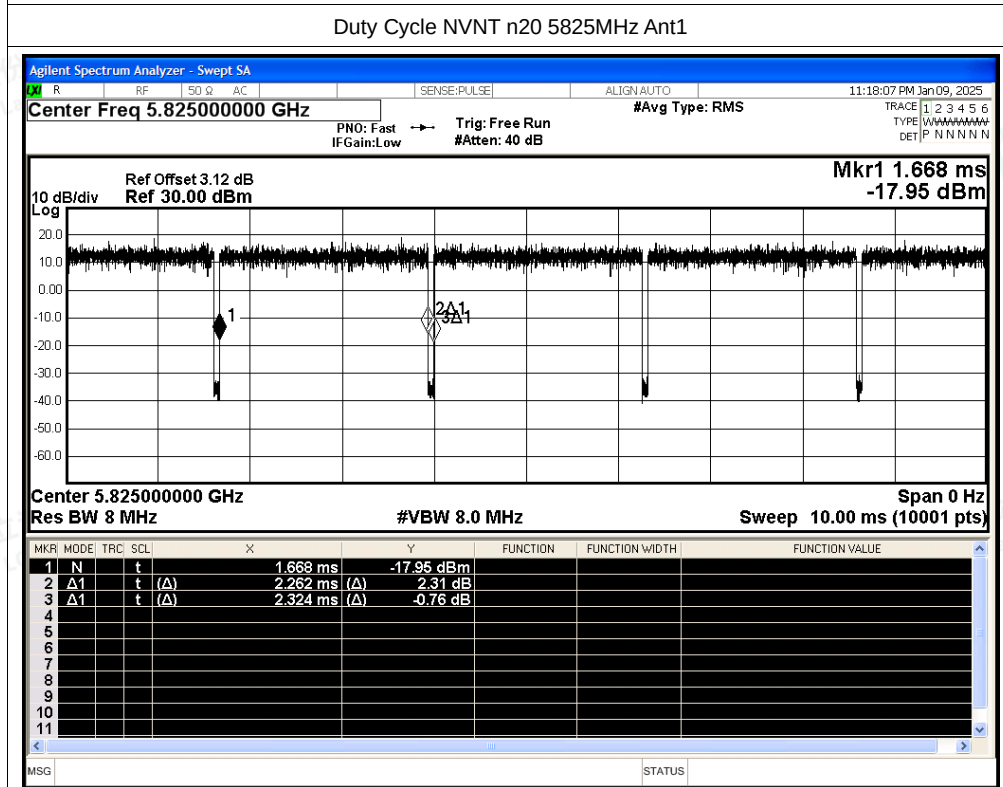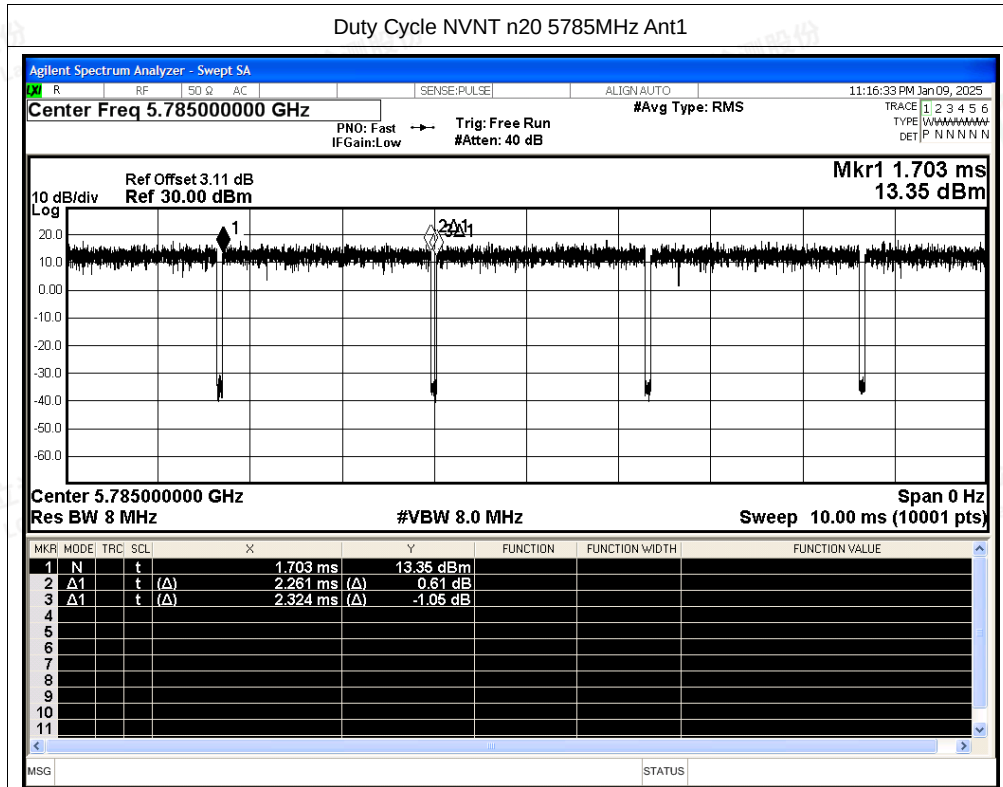



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



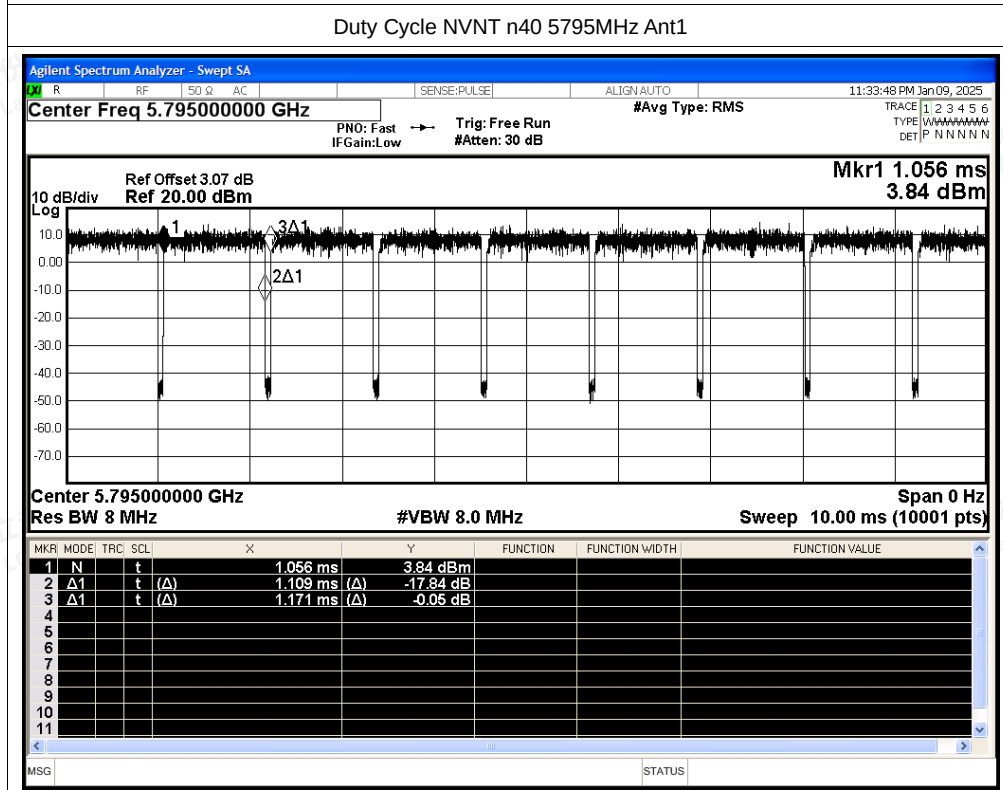
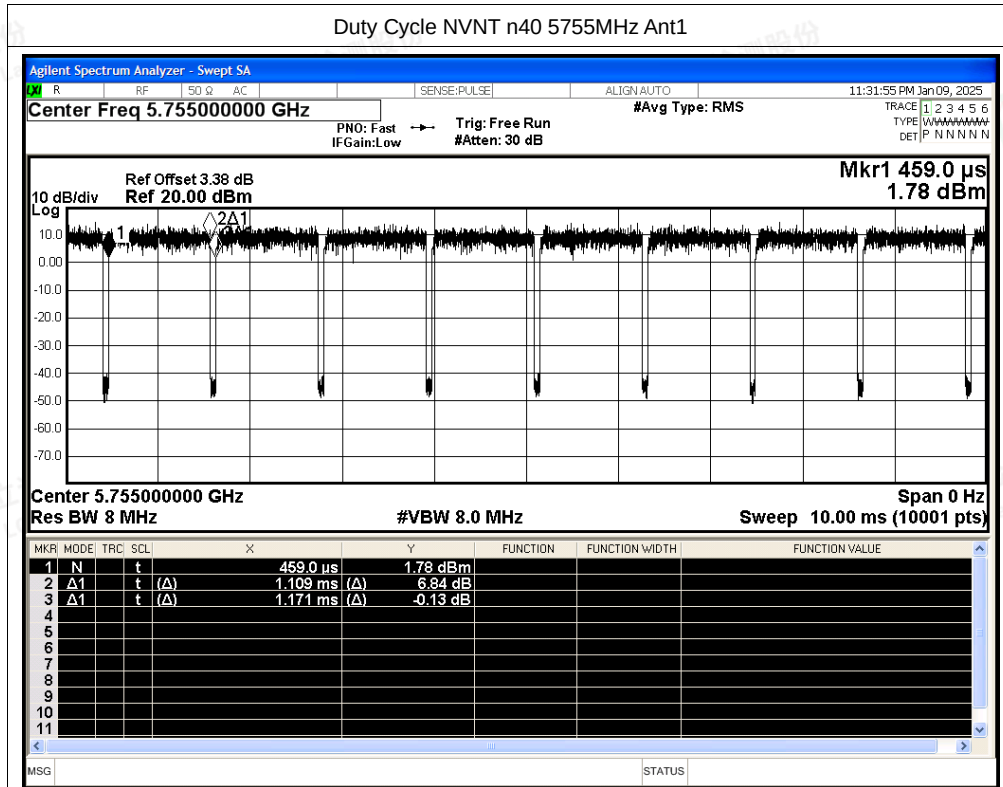


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

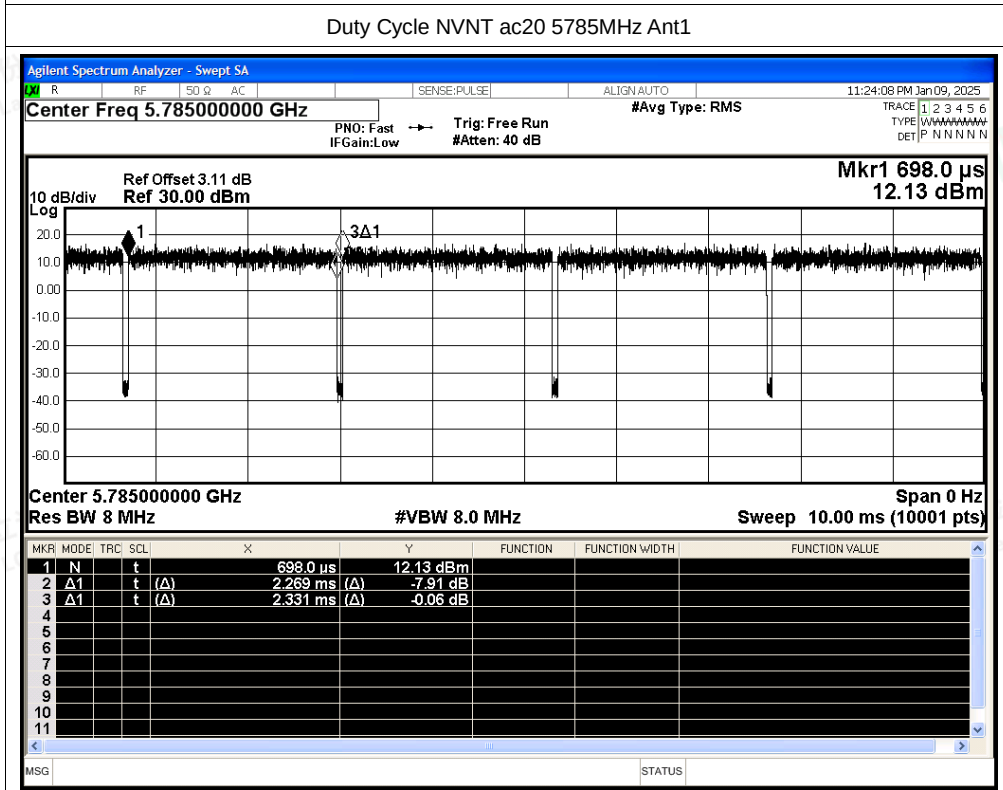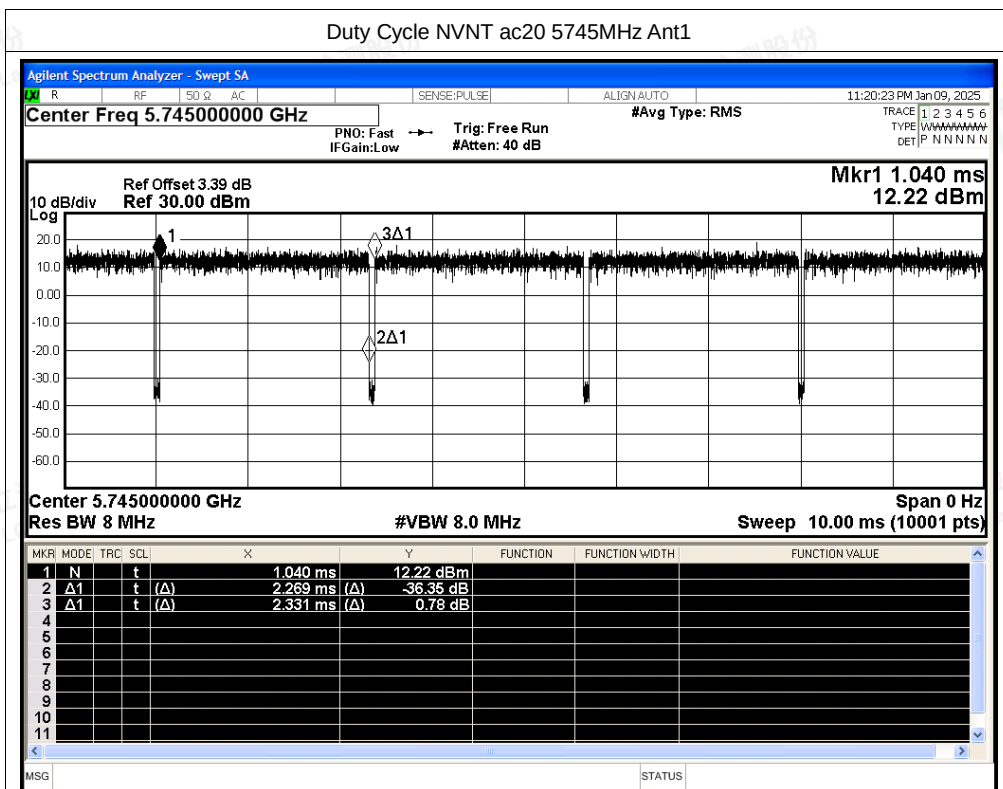

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5825MHz Ant1

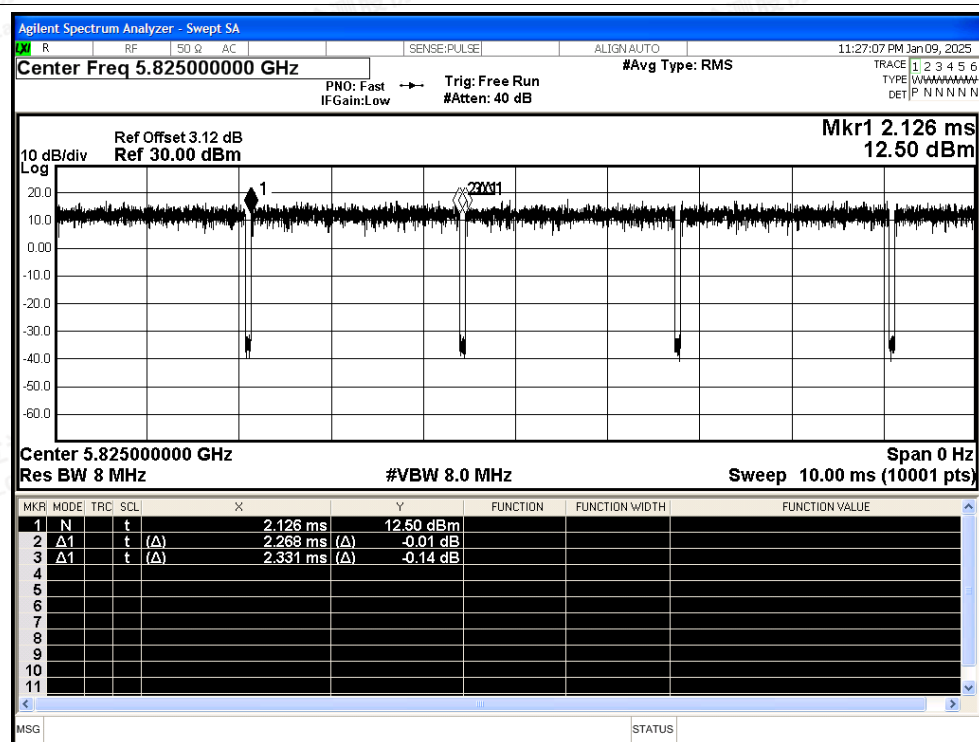

## Duty Cycle NVNT ac40 5755MHz Ant1


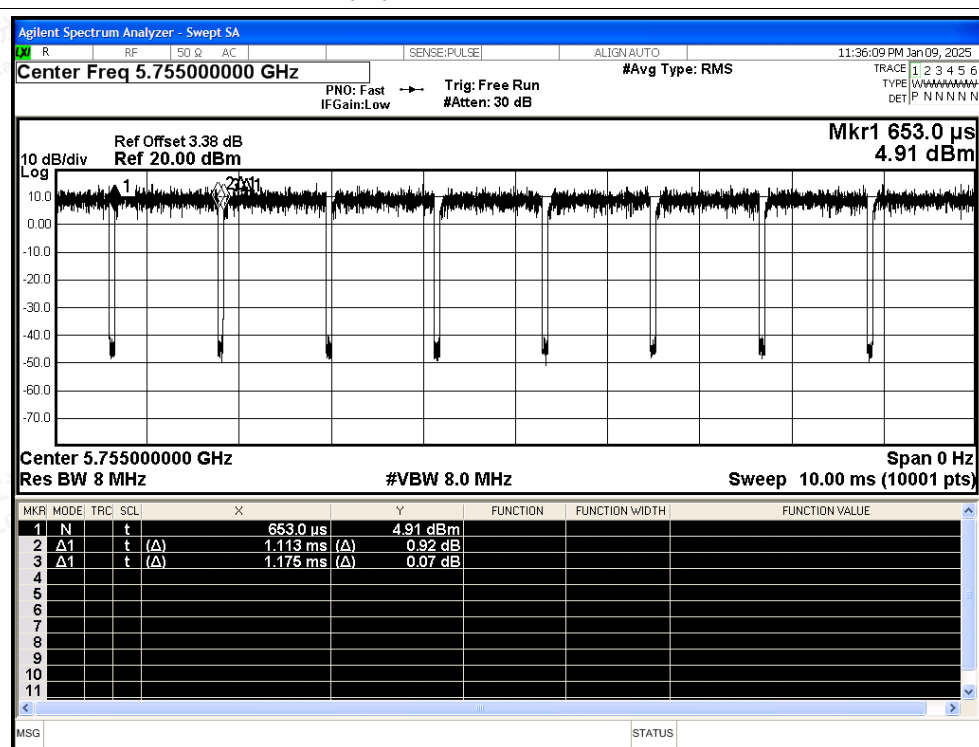


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

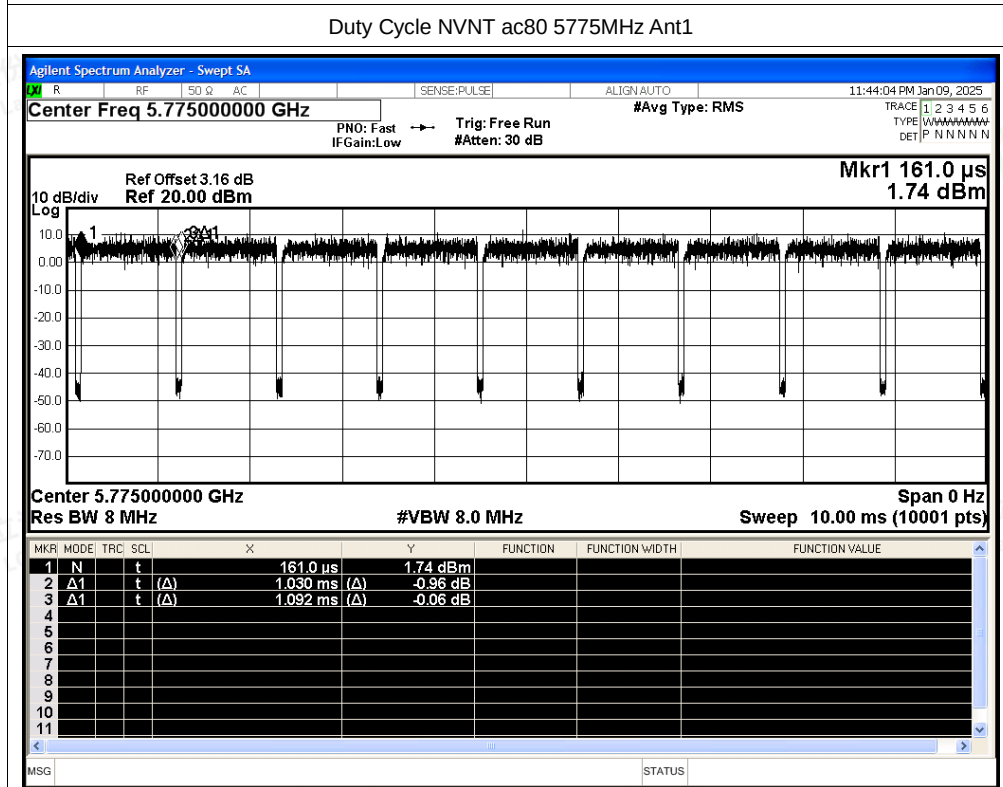
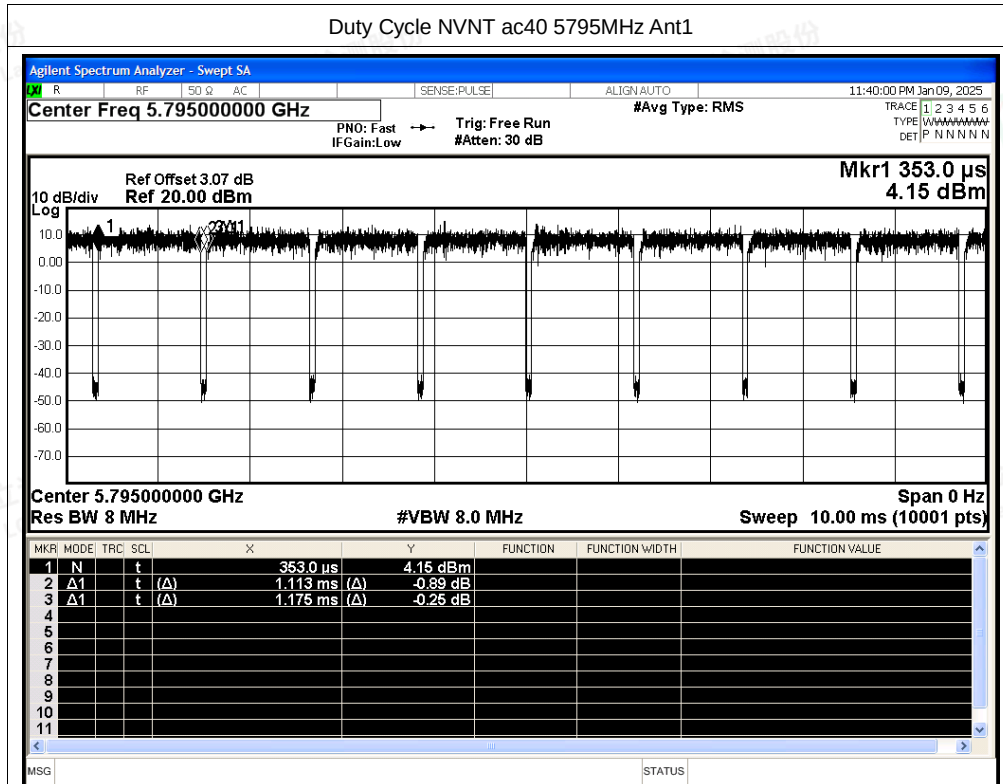


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

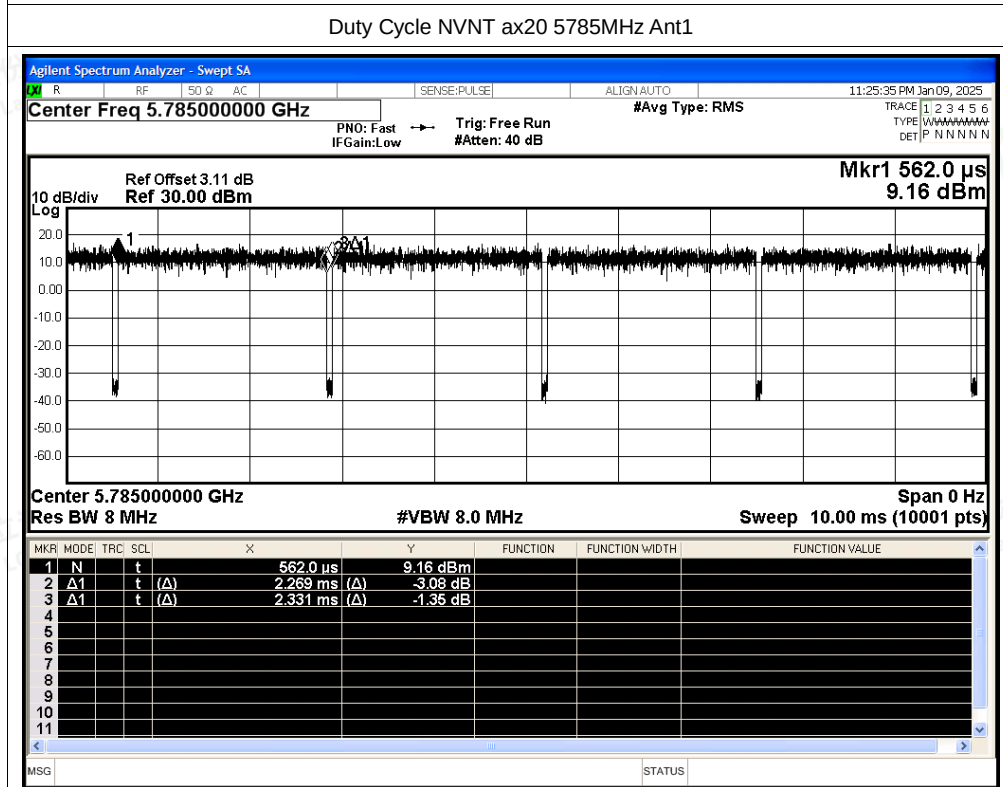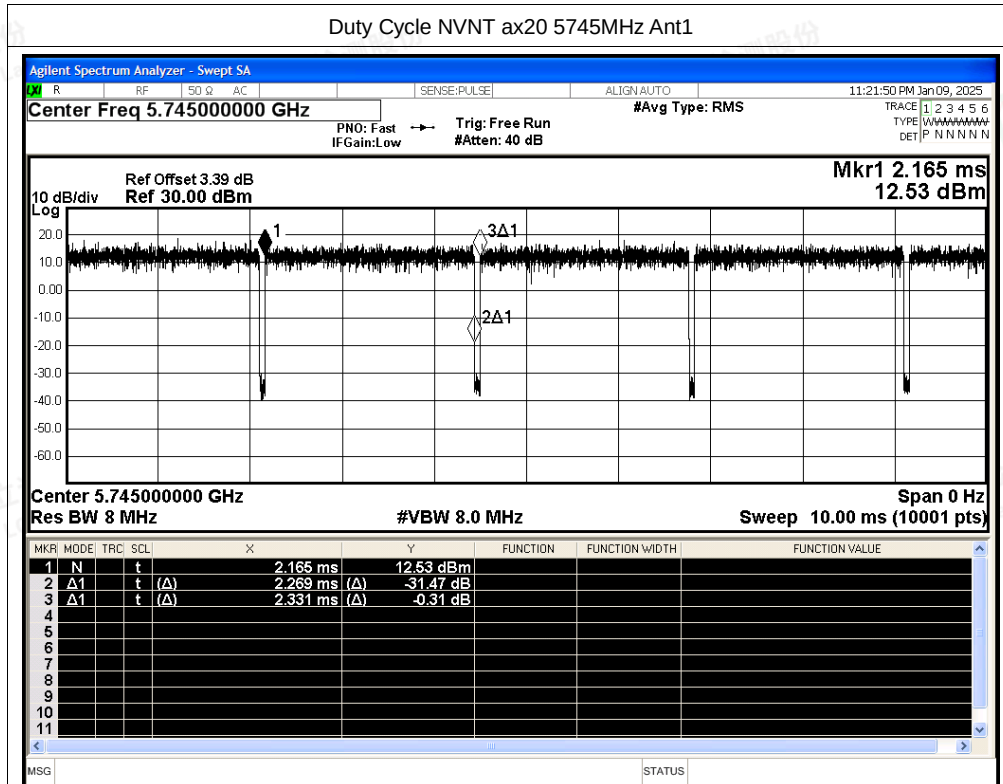

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5825MHz Ant1

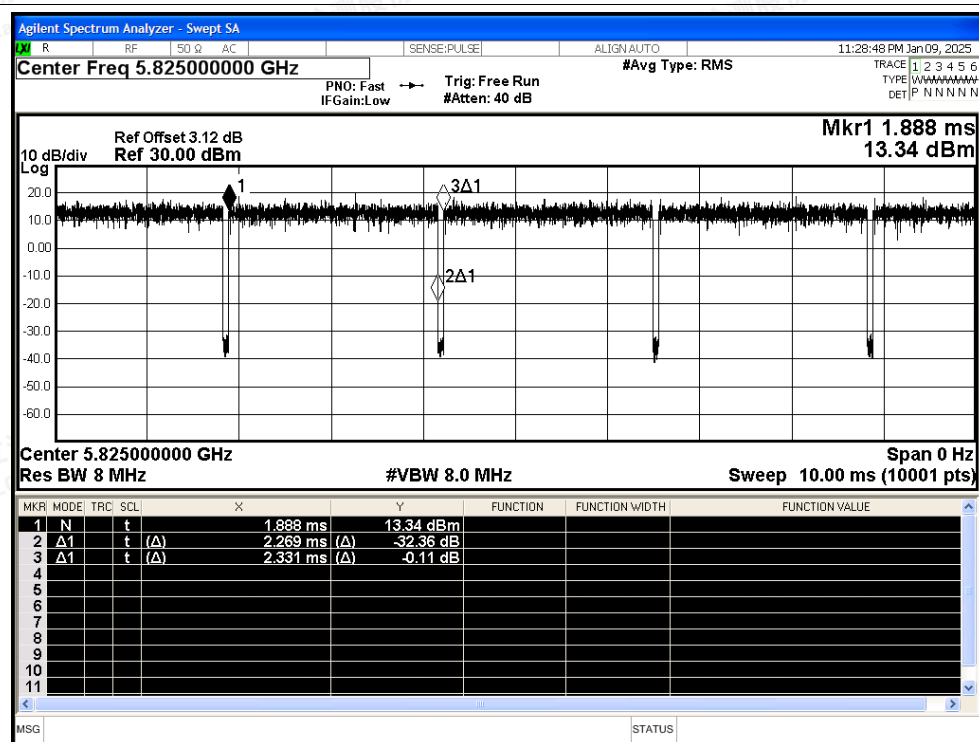

## Duty Cycle NVNT ax40 5755MHz Ant1

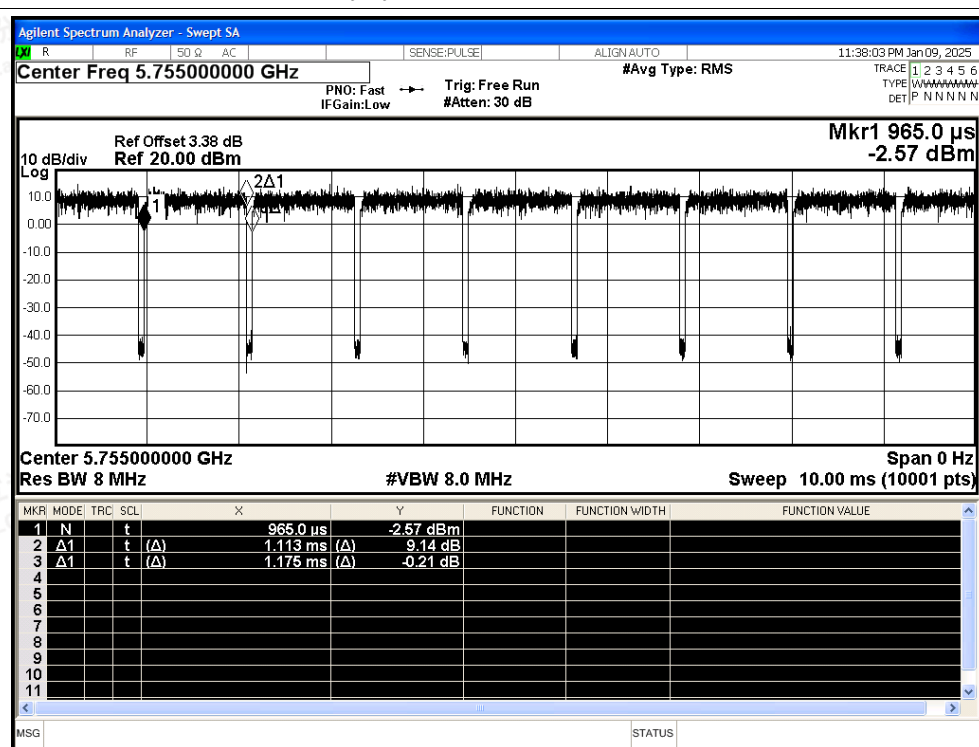

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5795MHz Ant1

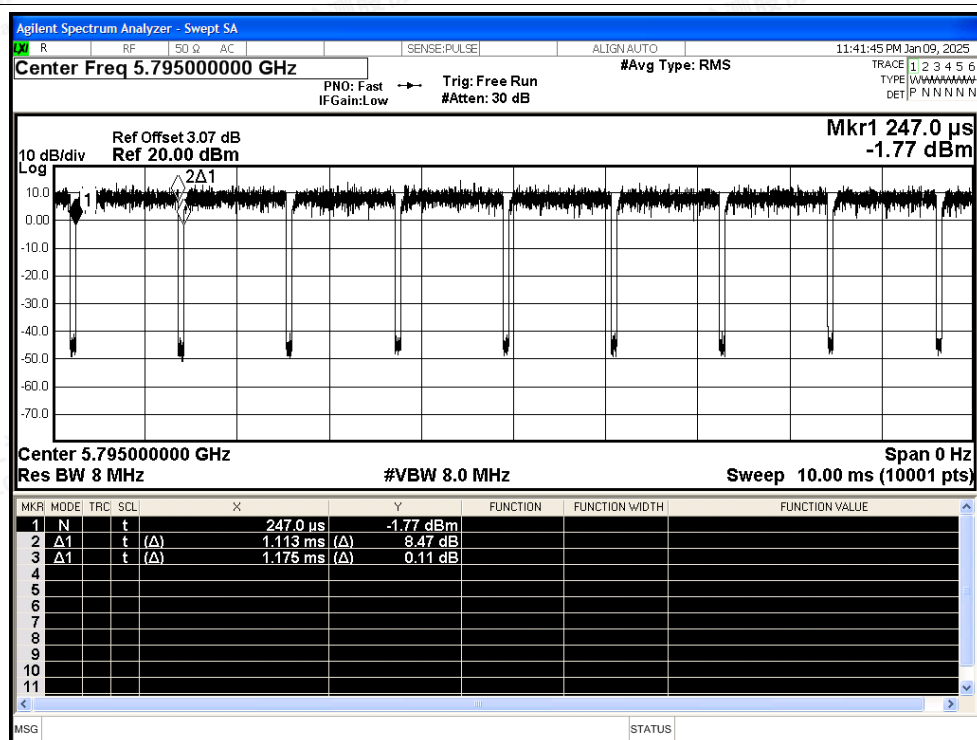

## Duty Cycle NVNT ax80 5775MHz Ant1

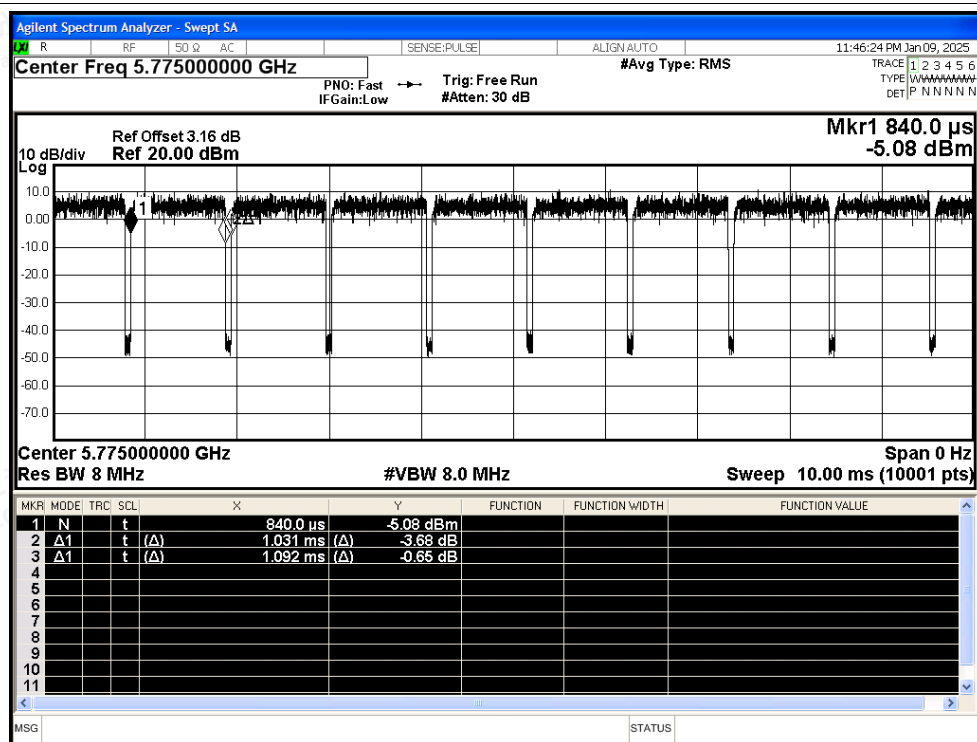

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant2    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5785            | Ant2    | 94.56          | 0.24                   | 0.91      |
| NVNT      | a    | 5825            | Ant2    | 94.65          | 0.24                   | 0.91      |
| NVNT      | n20  | 5745            | Ant2    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20  | 5785            | Ant2    | 97.29          | 0.12                   | 0.44      |
| NVNT      | n20  | 5825            | Ant2    | 97.33          | 0.12                   | 0.44      |
| NVNT      | n40  | 5755            | Ant2    | 94.71          | 0.24                   | 0.9       |
| NVNT      | n40  | 5795            | Ant2    | 94.71          | 0.24                   | 0.9       |
| NVNT      | ac20 | 5745            | Ant2    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac20 | 5785            | Ant2    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac20 | 5825            | Ant2    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ac40 | 5755            | Ant2    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ac40 | 5795            | Ant2    | 94.81          | 0.23                   | 0.9       |
| NVNT      | ac80 | 5775            | Ant2    | 94.32          | 0.25                   | 0.97      |
| NVNT      | ax20 | 5745            | Ant2    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20 | 5785            | Ant2    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax20 | 5825            | Ant2    | 97.34          | 0.12                   | 0.44      |
| NVNT      | ax40 | 5755            | Ant2    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ax40 | 5795            | Ant2    | 94.72          | 0.24                   | 0.9       |
| NVNT      | ax80 | 5775            | Ant2    | 94.32          | 0.25                   | 0.97      |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Duty Cycle NVNT a 5745MHz Ant2

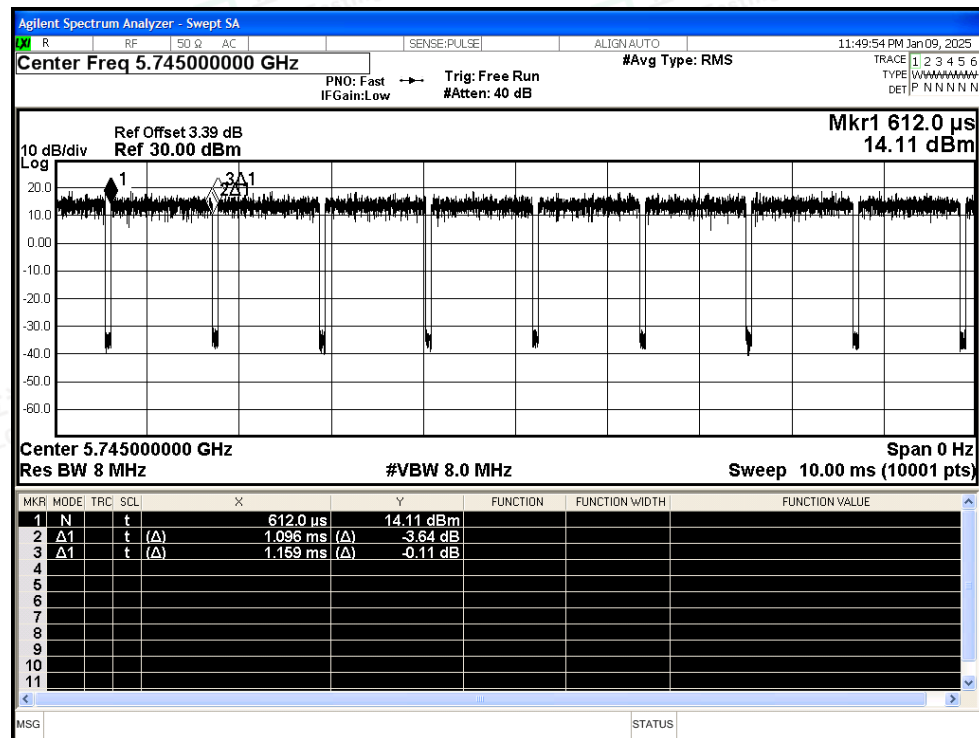

## Duty Cycle NVNT a 5785MHz Ant2


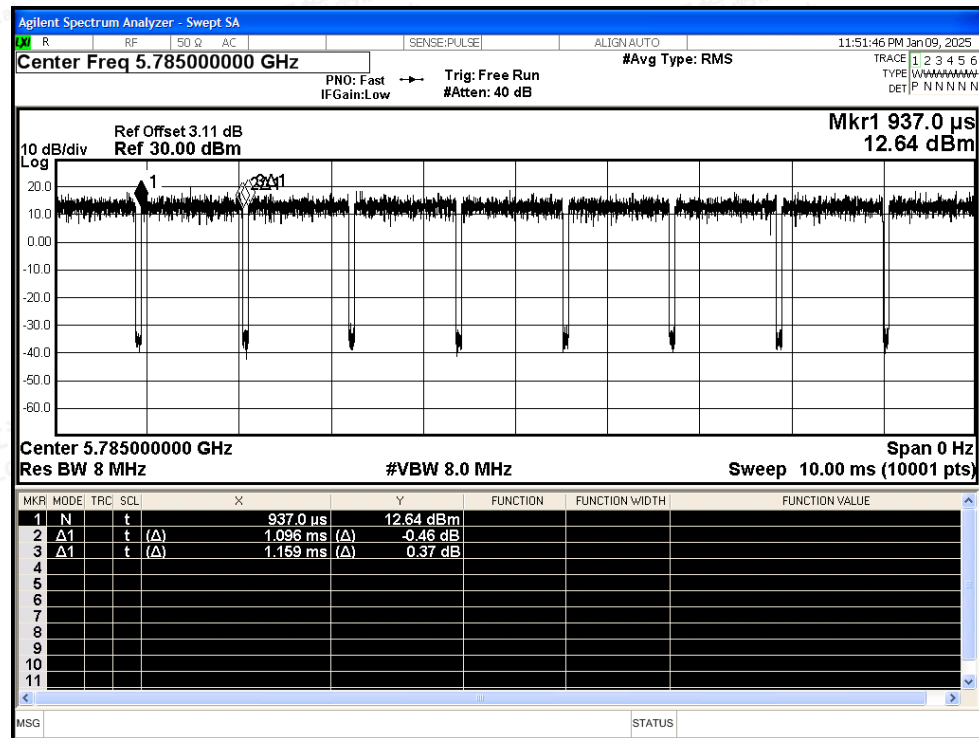


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

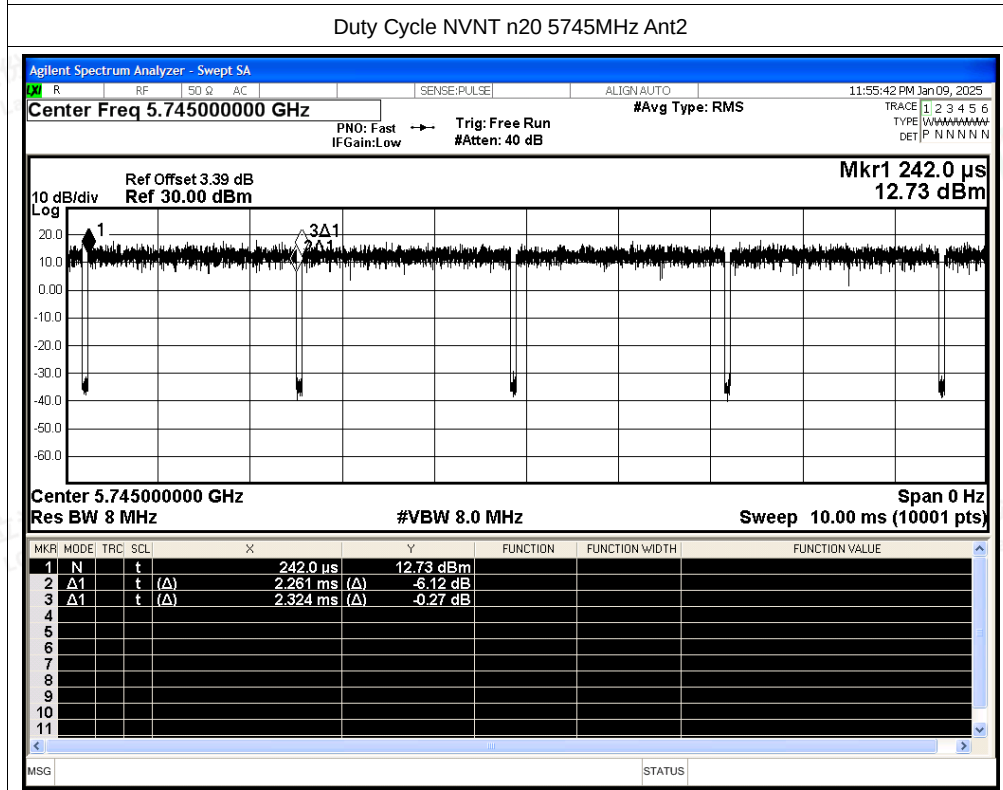
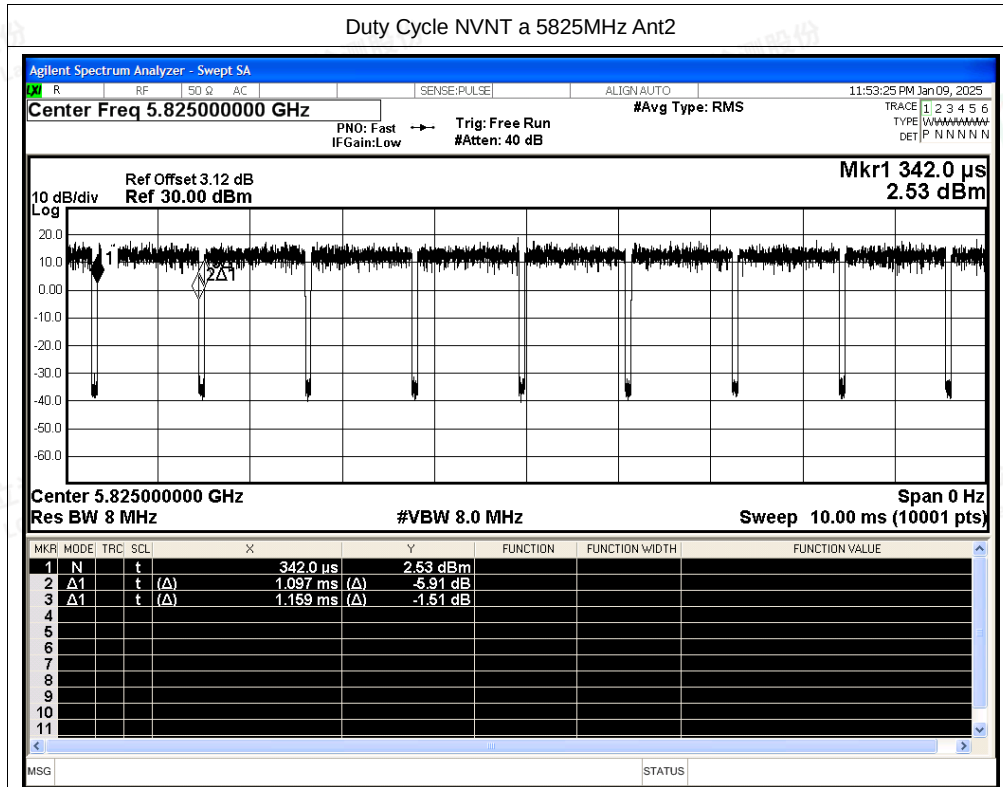


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

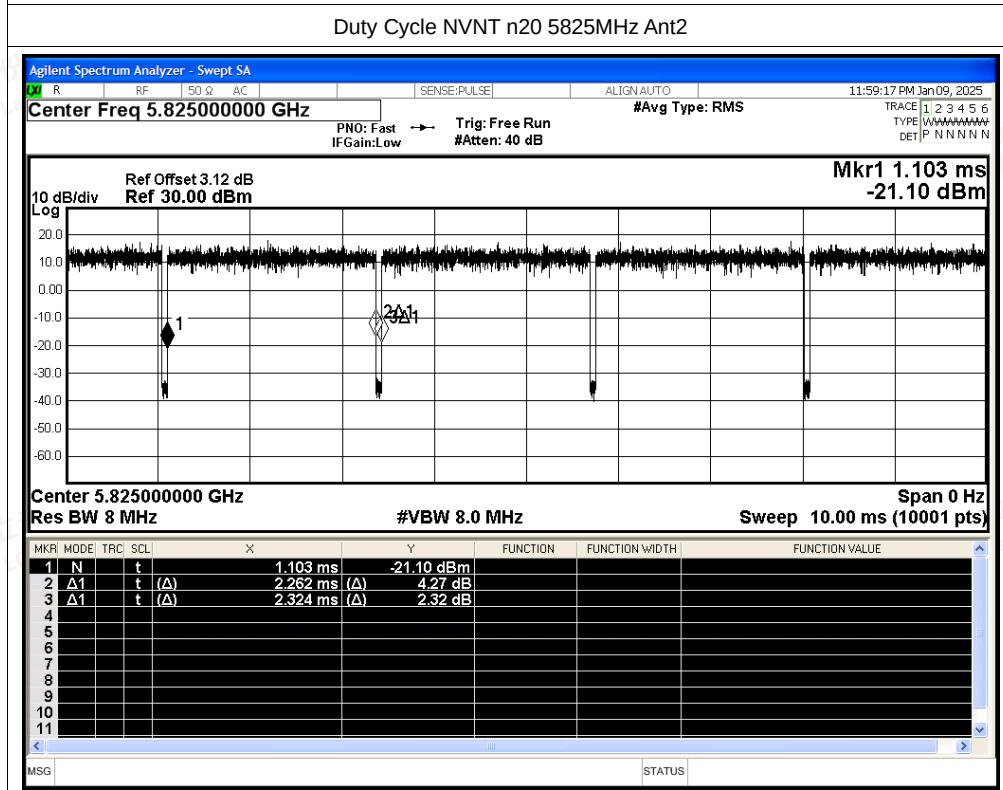
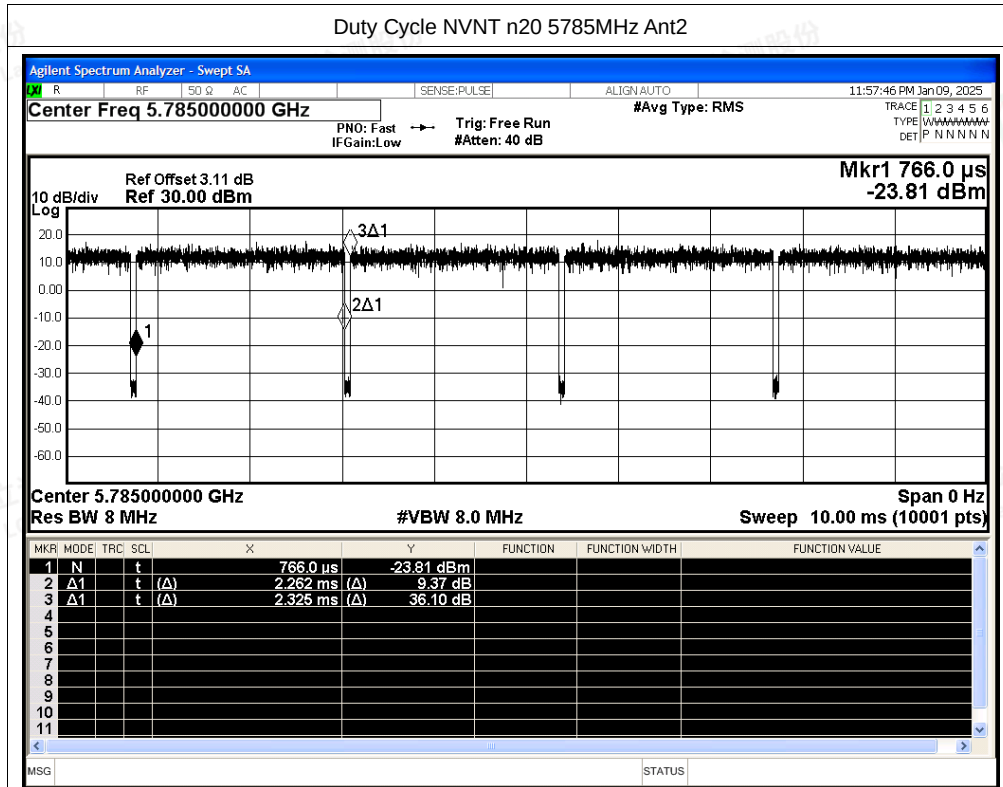


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

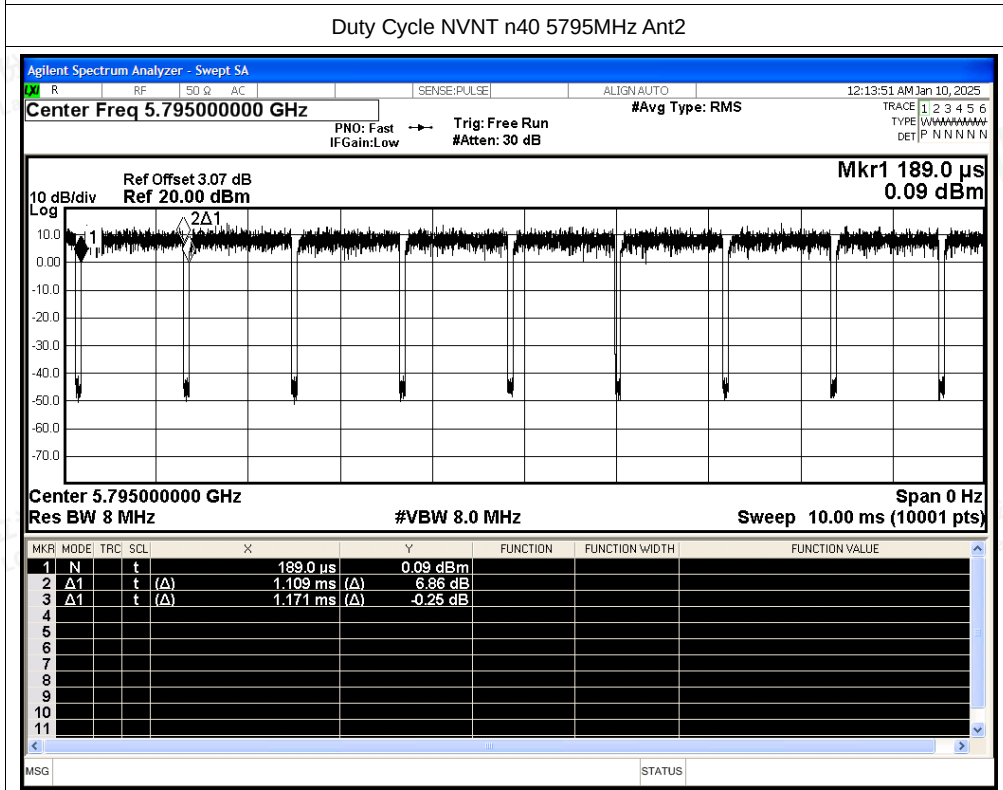
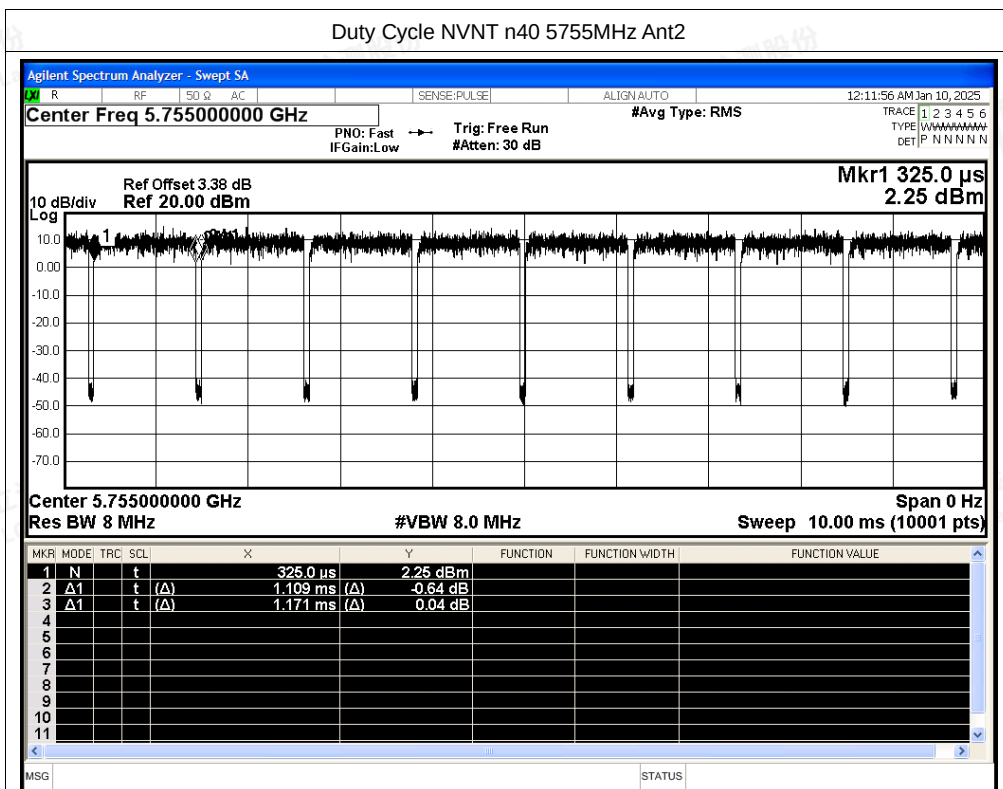


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

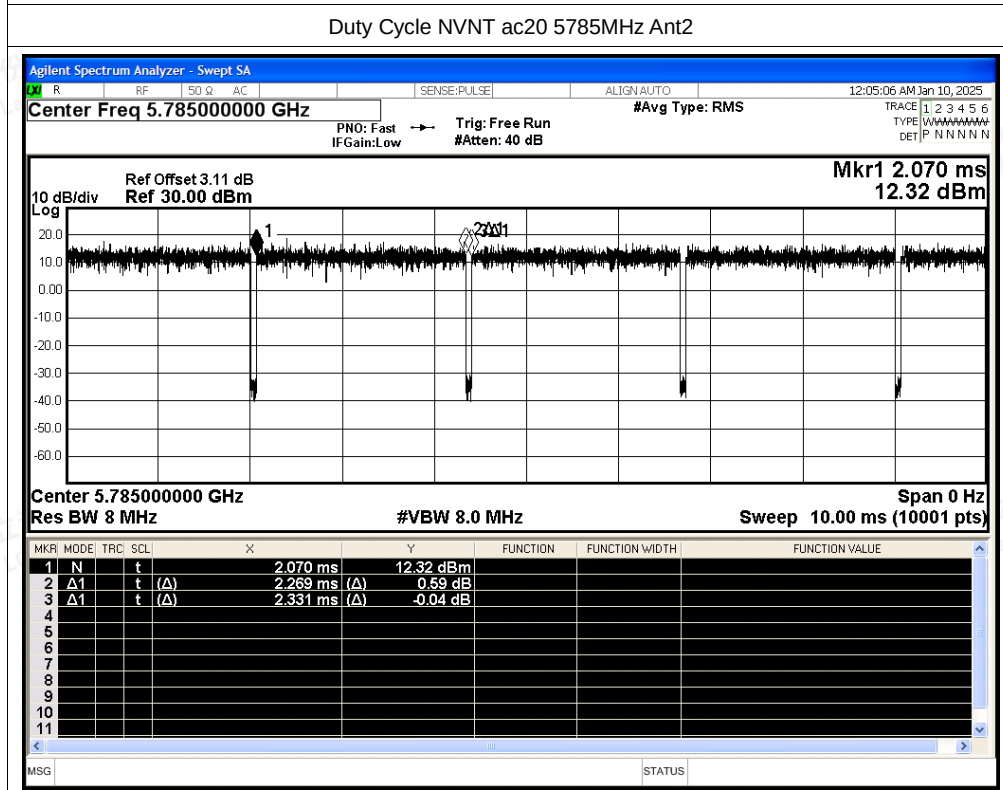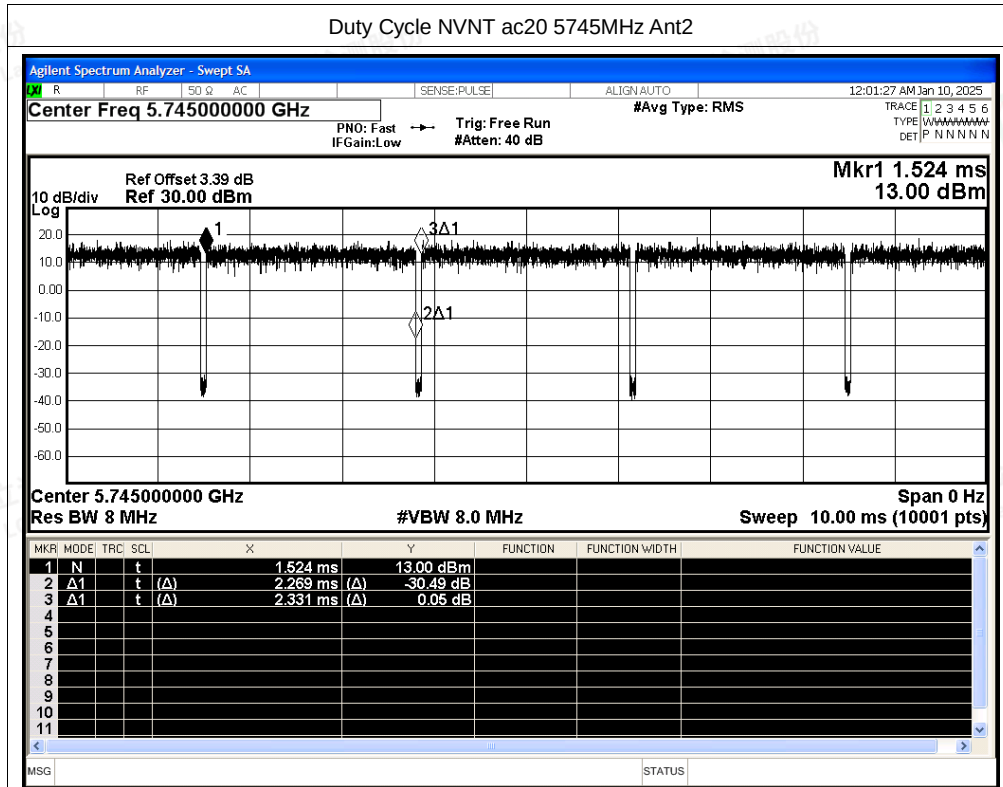

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5825MHz Ant2

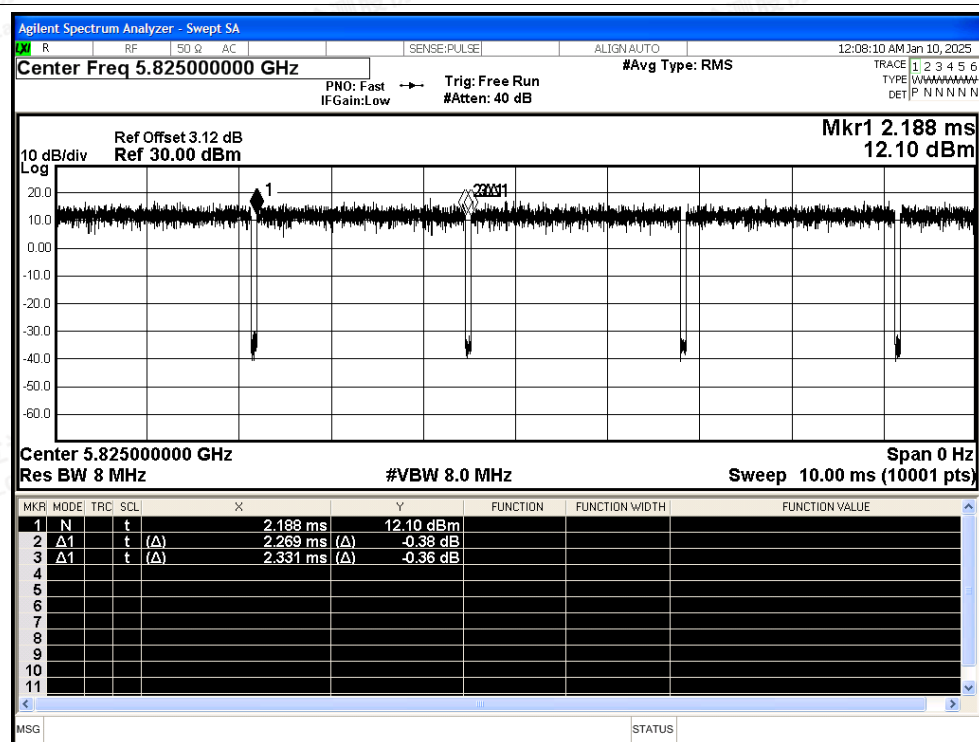

## Duty Cycle NVNT ac40 5755MHz Ant2

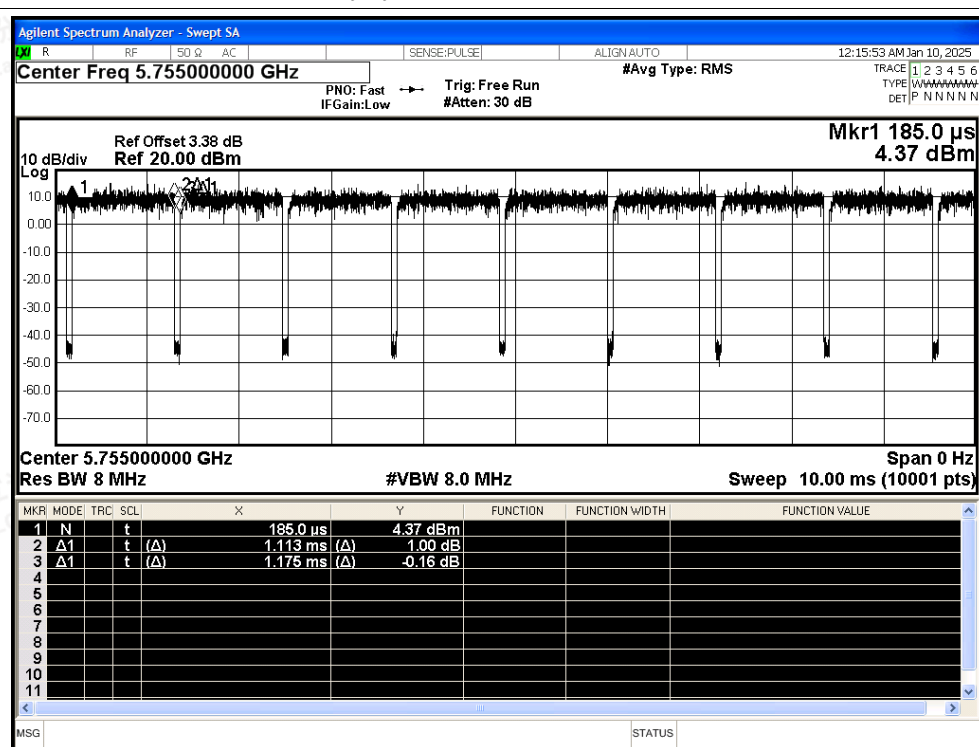



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



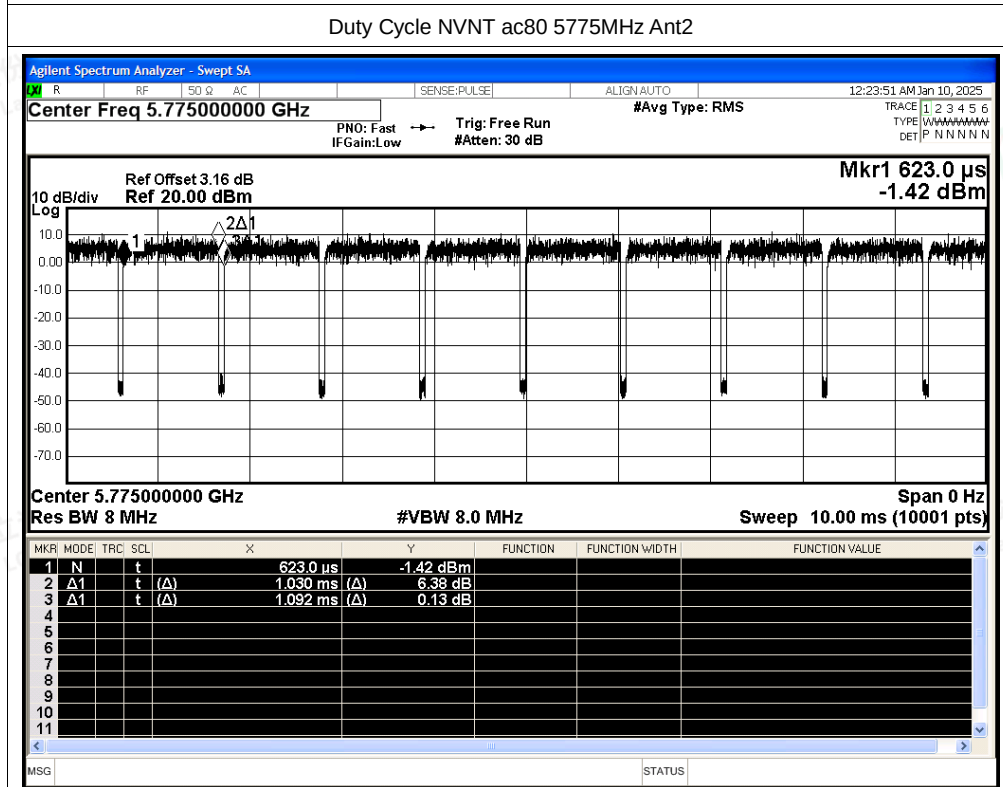
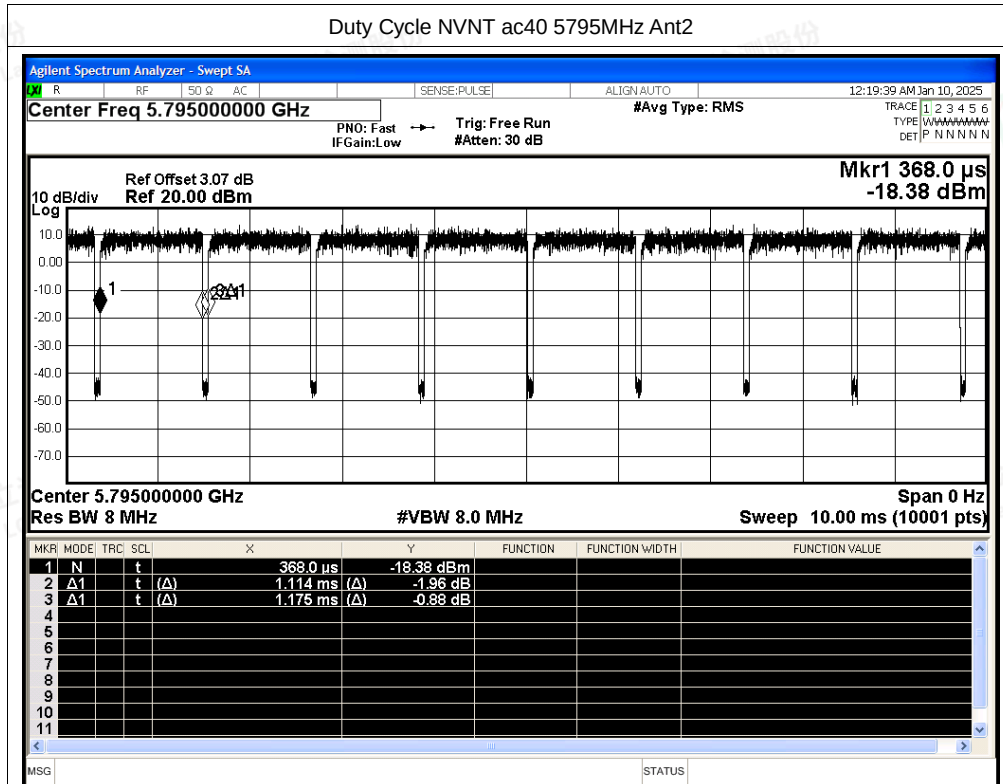


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

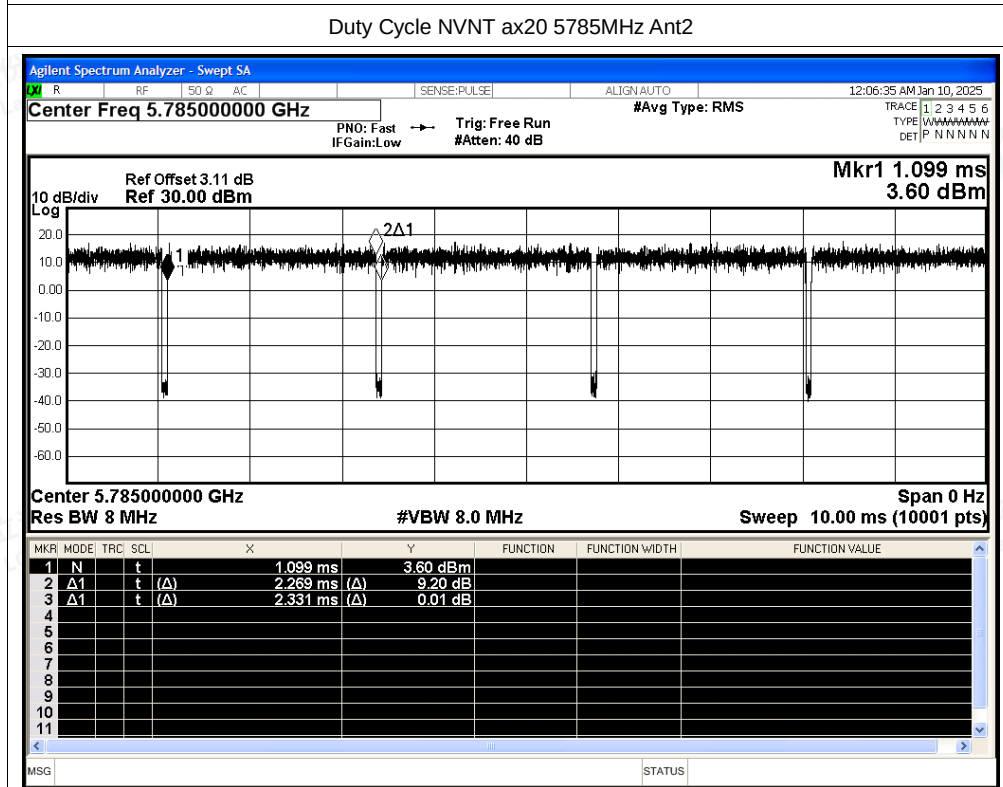
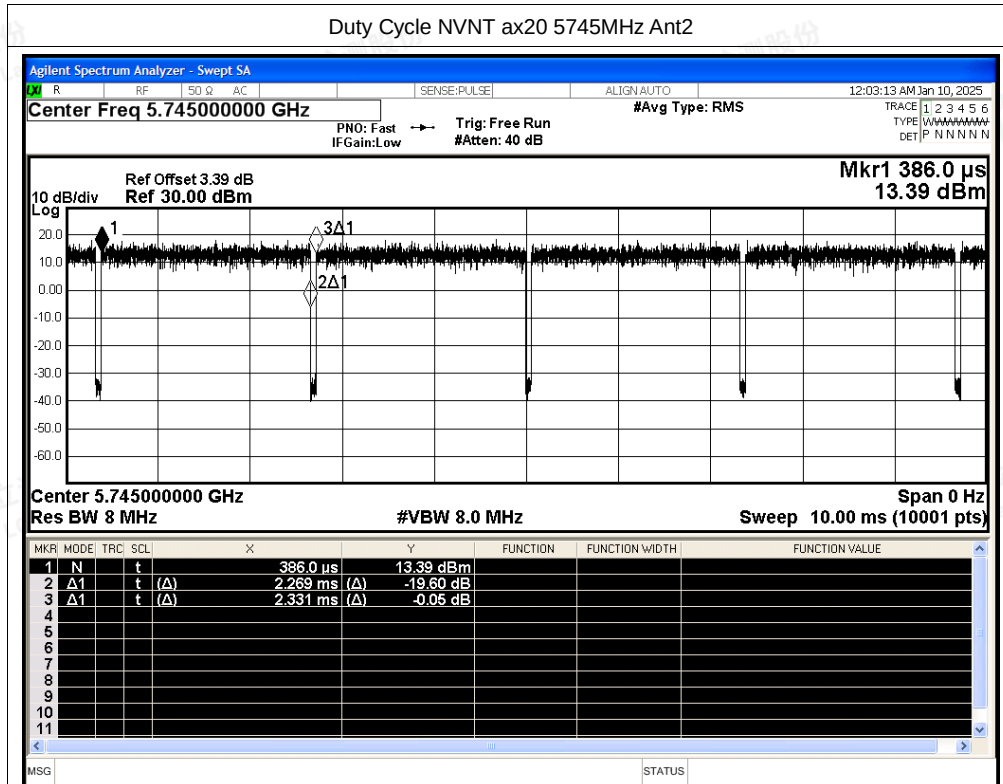


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

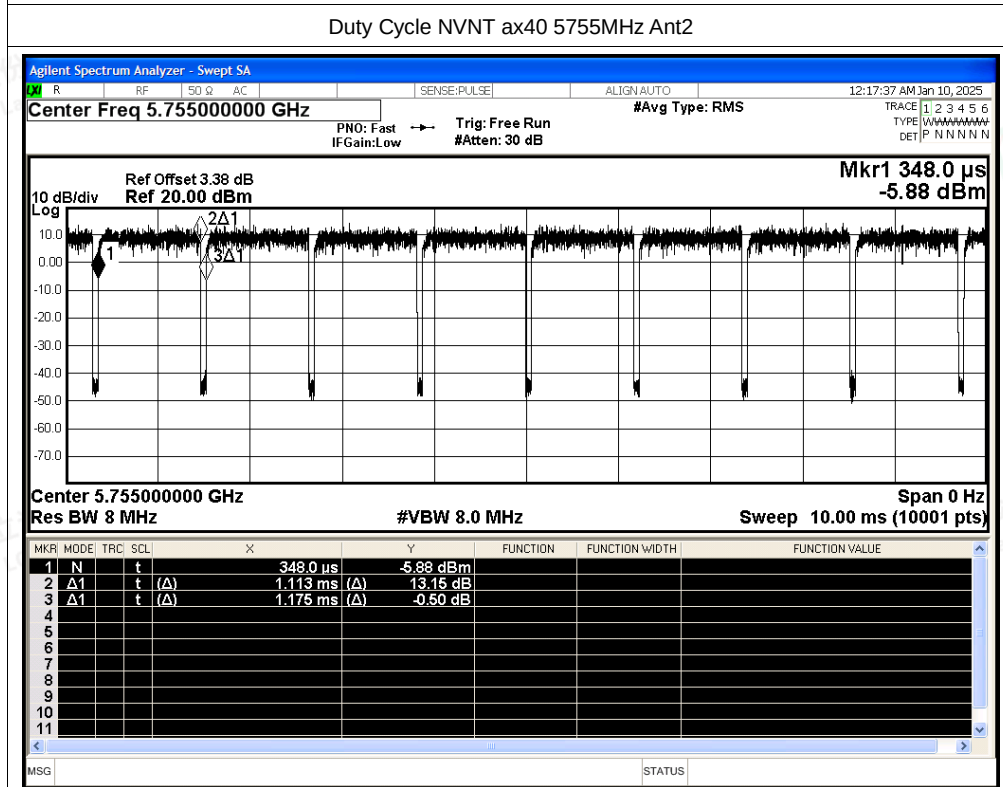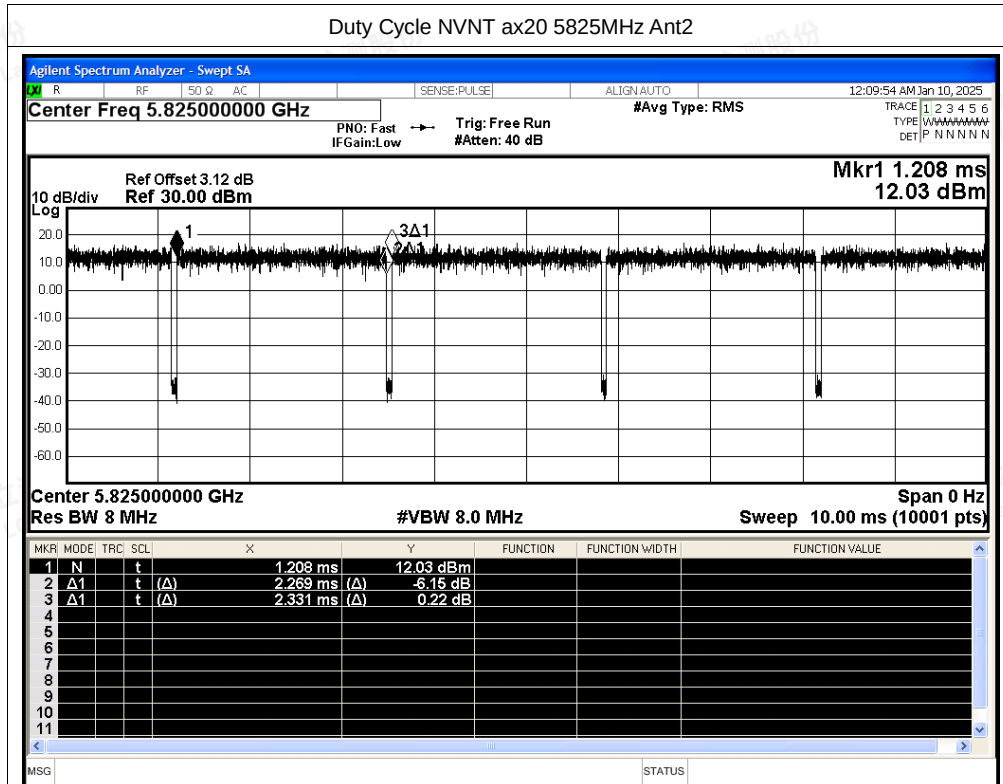

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5795MHz Ant2

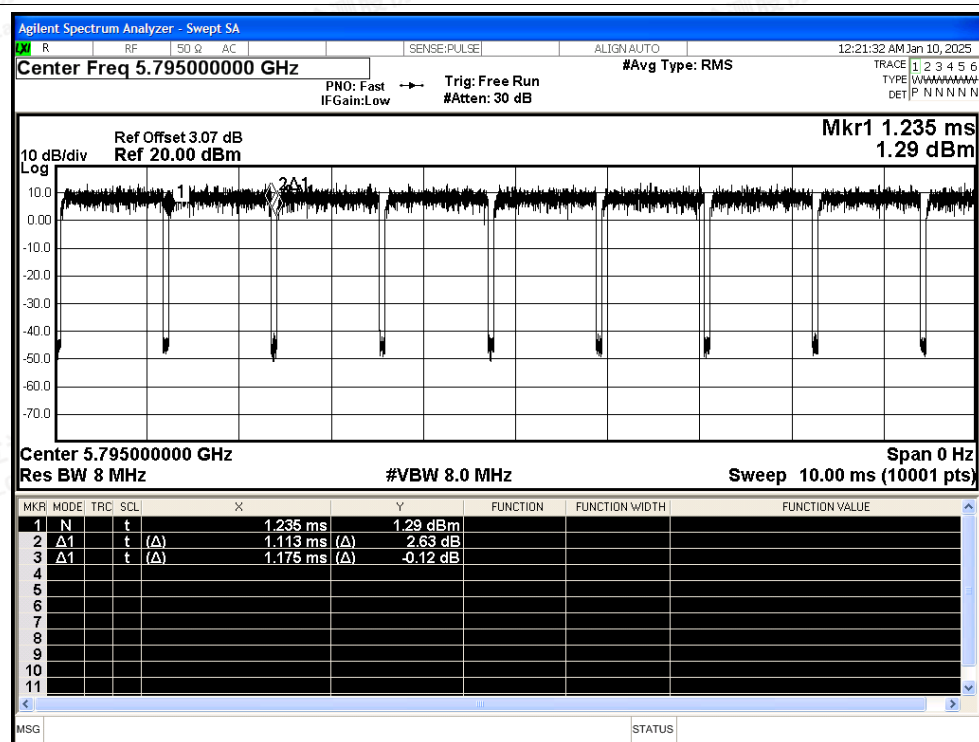

## Duty Cycle NVNT ax80 5775MHz Ant2

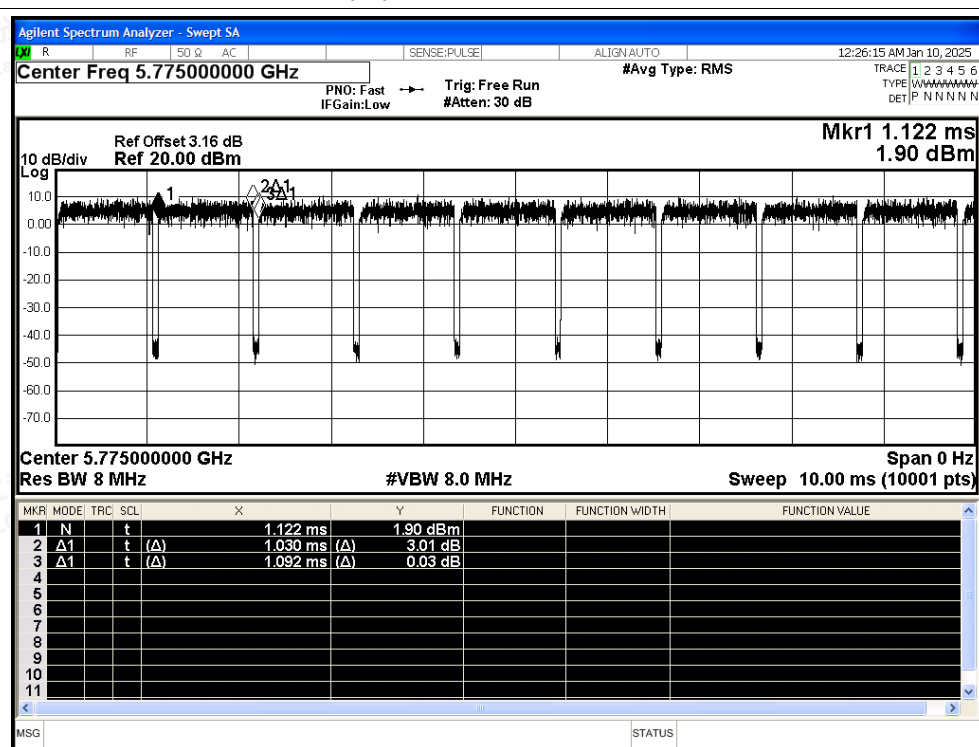

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity