




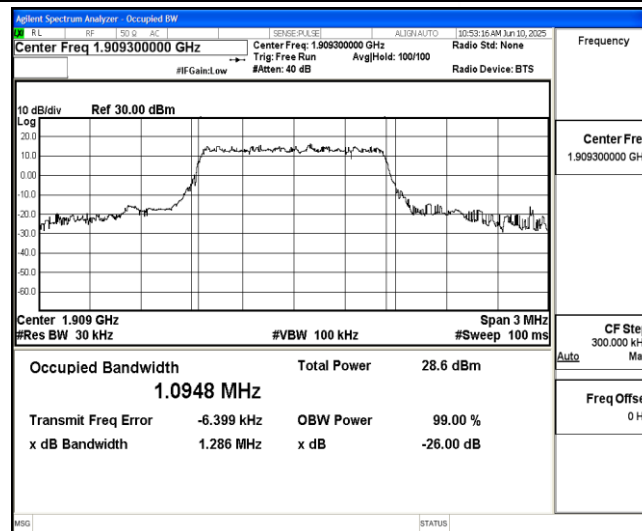

Band2-1.4MHz-16QAM-19193-6-0-High-1.0948-1.286-PASS

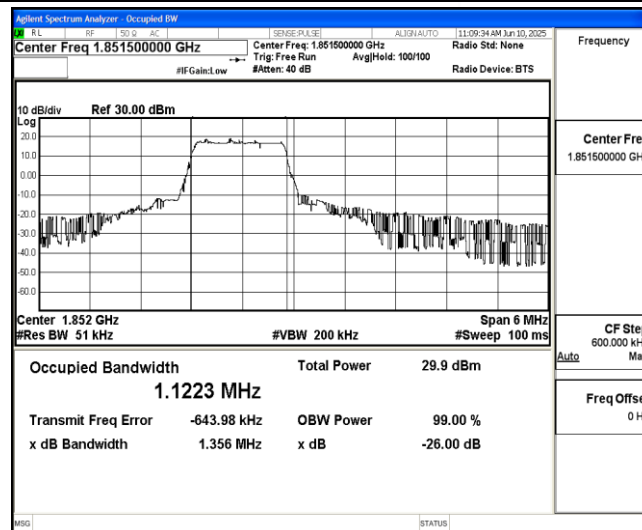


Band2-3MHz-QPSK-18615-6-0-Low-1.1223-1.356-PASS

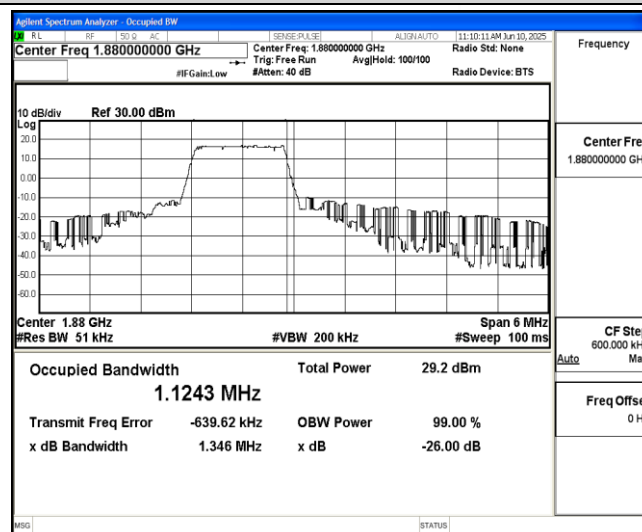


Band2-3MHz-QPSK-18900-6-0-Low-1.1243-1.346-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

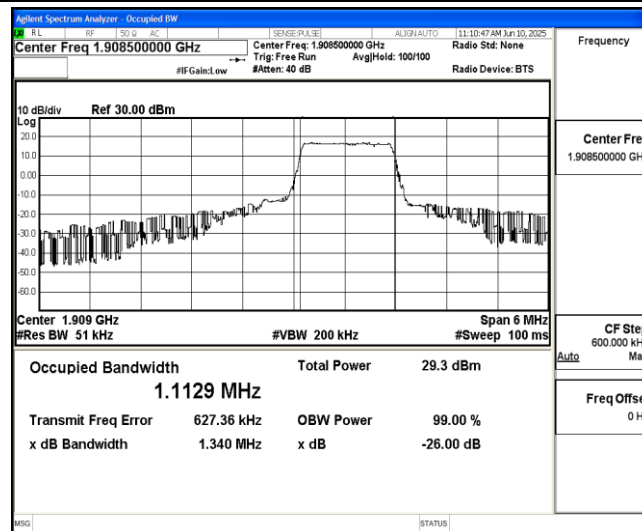

Band2-3MHz-QPSK-19185-6-0-High-1.1129-1.340-PASS

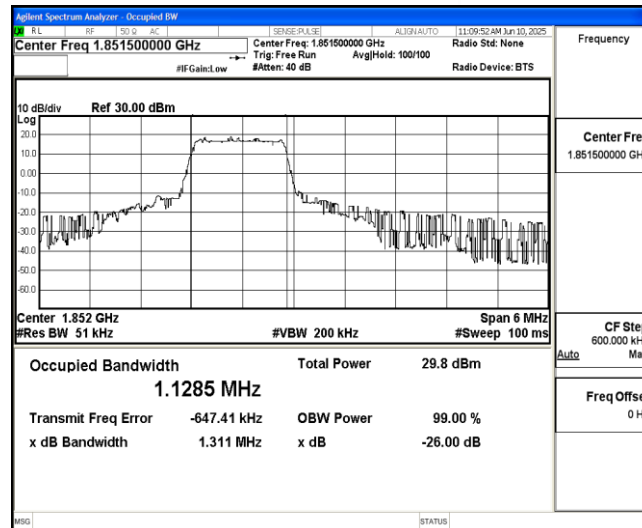


Band2-3MHz-16QAM-18615-6-0-Low-1.1285-1.311-PASS

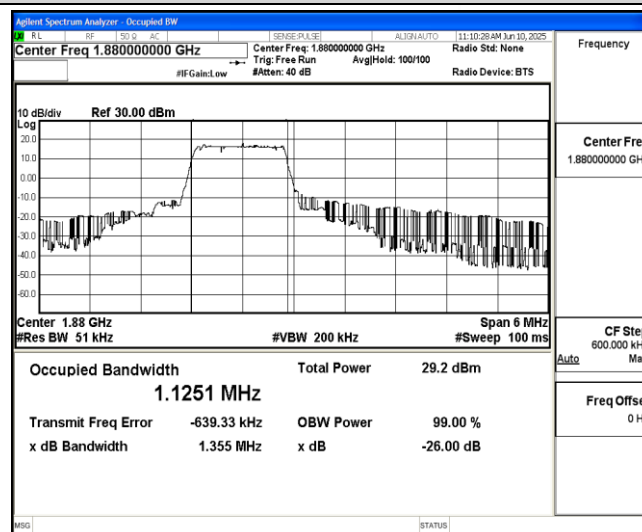


Band2-3MHz-16QAM-18900-6-0-Low-1.1251-1.355-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

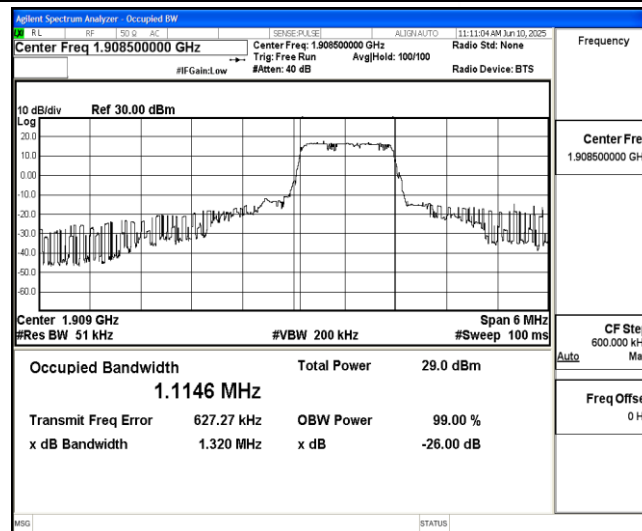

Band2-3MHz-16QAM-19185-6-0-High-1.1146-1.320-PASS

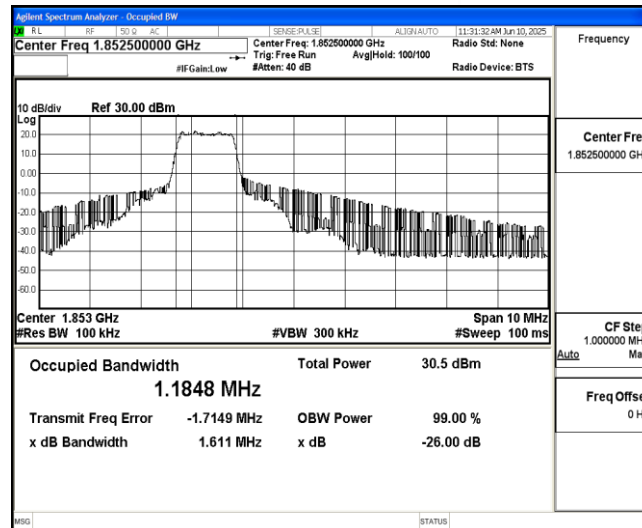


Band2-5MHz-QPSK-18625-6-0-Low-1.1848-1.611-PASS

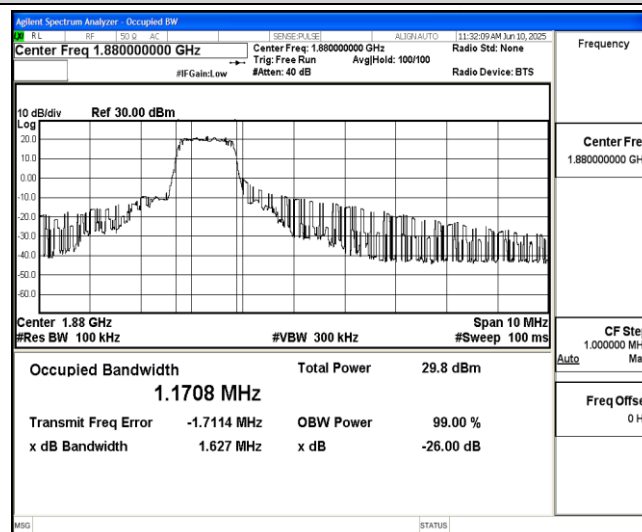


Band2-5MHz-QPSK-18900-6-0-Low-1.1708-1.627-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

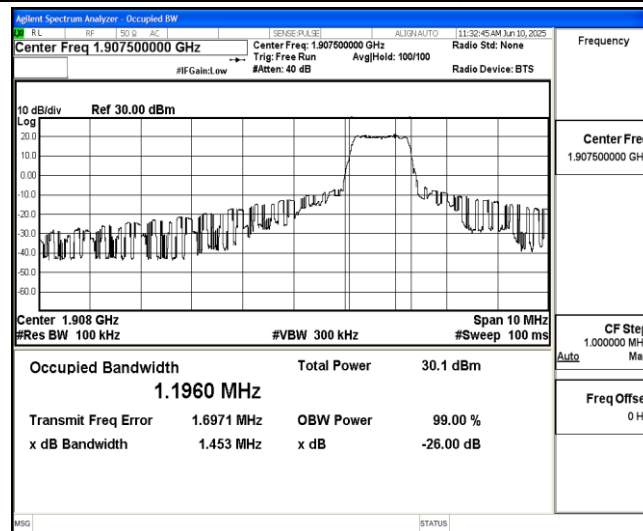

Band2-5MHz-QPSK-19175-6-0-High-1.1960-1.453-PASS

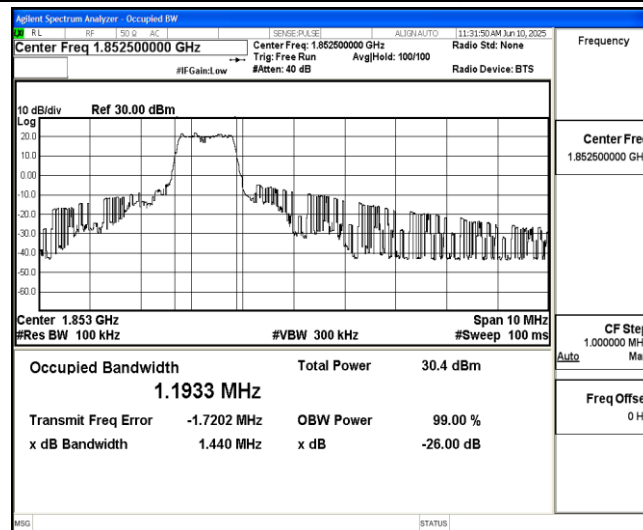


Band2-5MHz-16QAM-18625-6-0-Low-1.1933-1.440-PASS

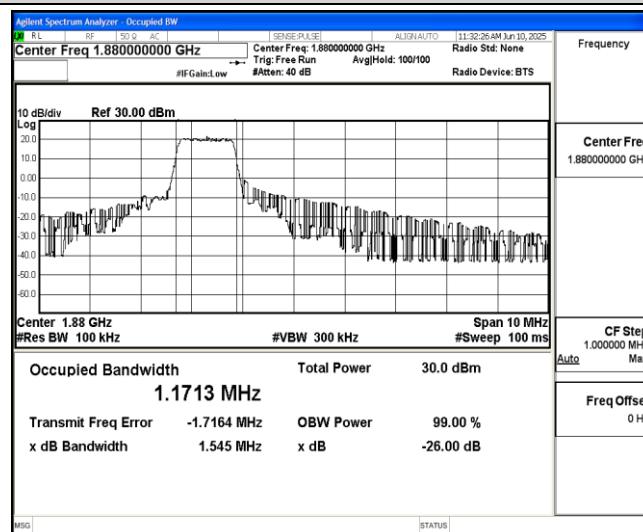


Band2-5MHz-16QAM-18900-6-0-Low-1.1713-1.545-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

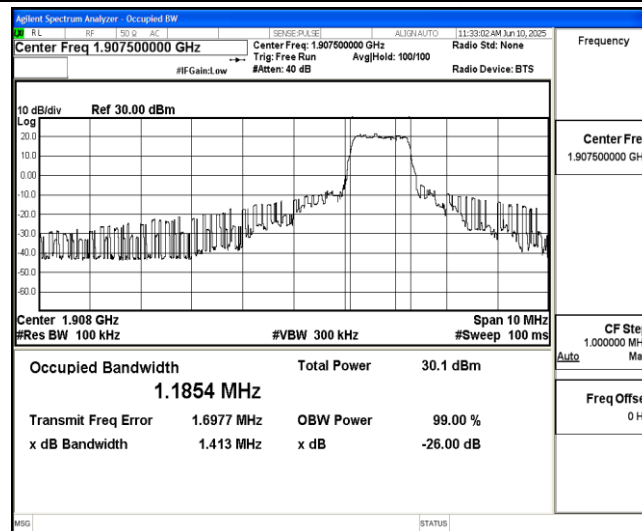

Band2-5MHz-16QAM-19175-6-0-High-1.1854-1.413-PASS

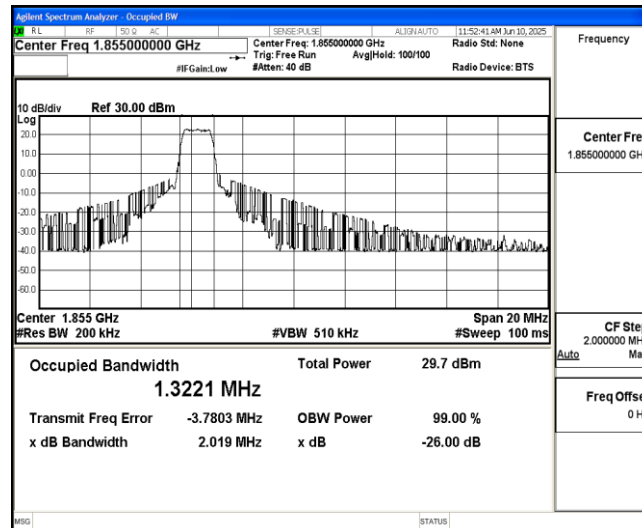


Band2-10MHz-QPSK-18650-6-0-Low-1.3221-2.019-PASS

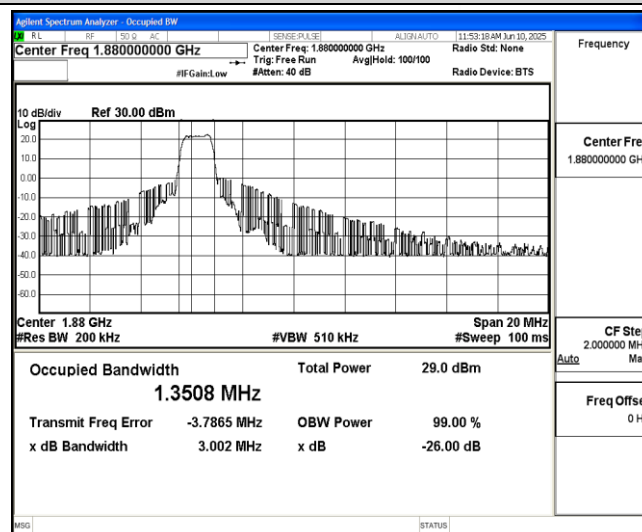


Band2-10MHz-QPSK-18900-6-0-Low-1.3508-3.002-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

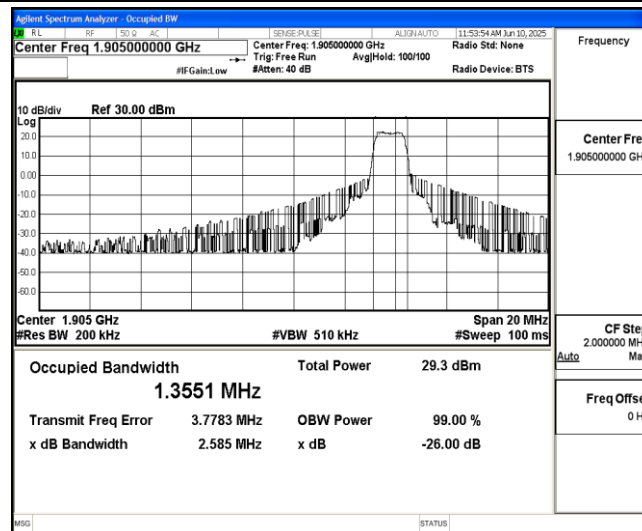

Band2-10MHz-QPSK-19150-6-0-High-1.3551-2.585-PASS

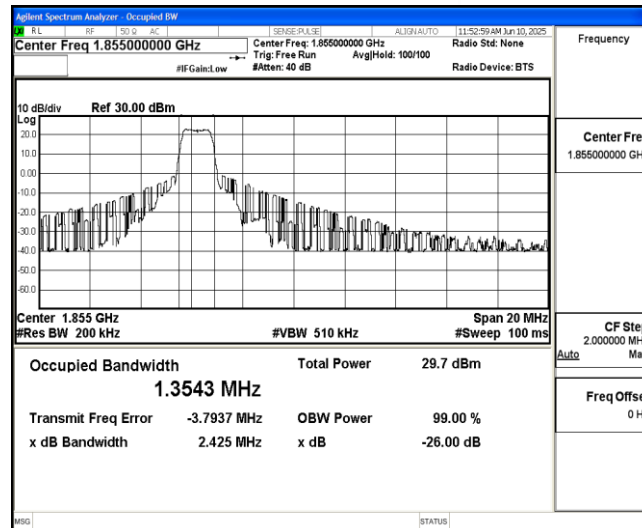


Band2-10MHz-16QAM-18650-6-0-Low-1.3543-2.425-PASS

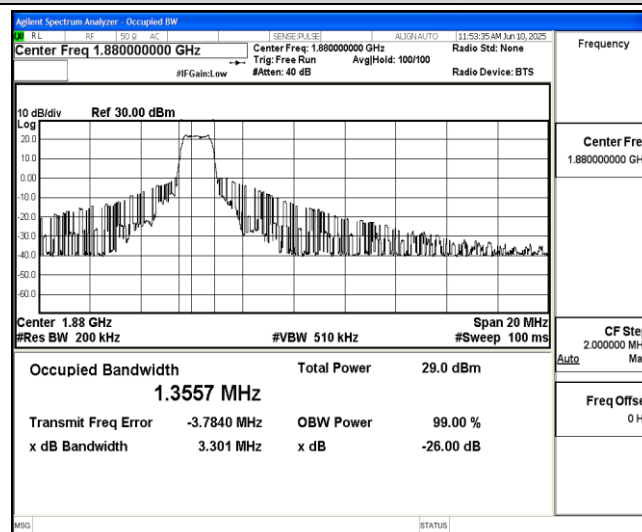


Band2-10MHz-16QAM-18900-6-0-Low-1.3557-3.301-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

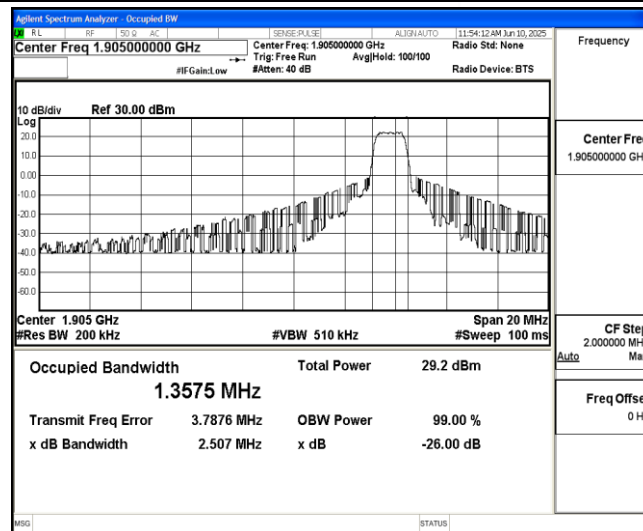

Band2-10MHz-16QAM-19150-6-0-High-1.3575-2.507-PASS

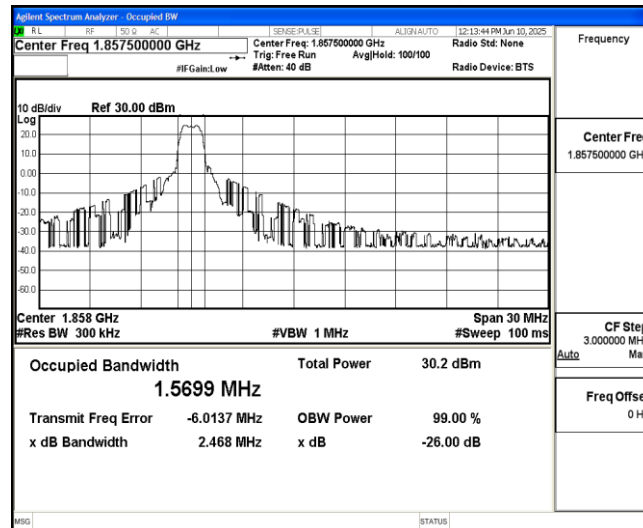


Band2-15MHz-QPSK-18675-6-0-Low-1.5699-2.468-PASS

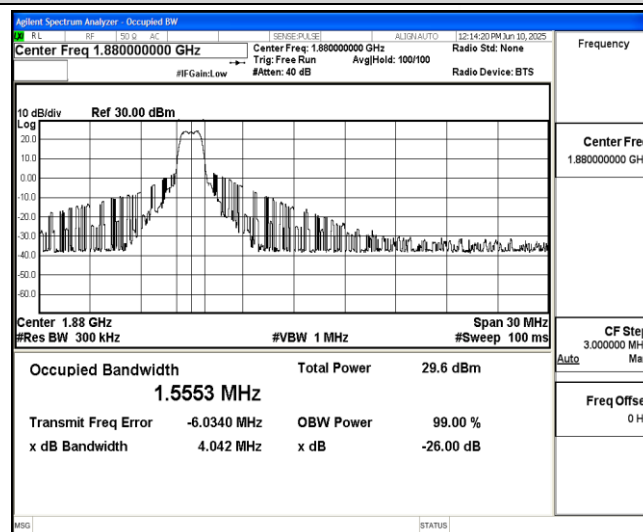


Band2-15MHz-QPSK-18900-6-0-Low-1.5553-4.042-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

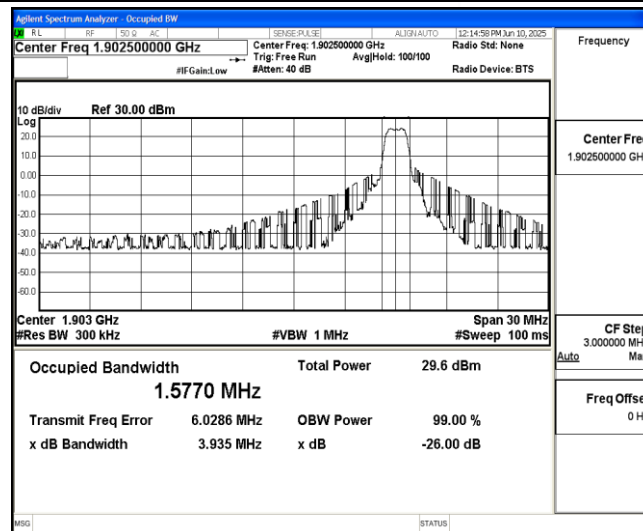

Band2-15MHz-QPSK-19125-6-0-High-1.5770-3.935-PASS

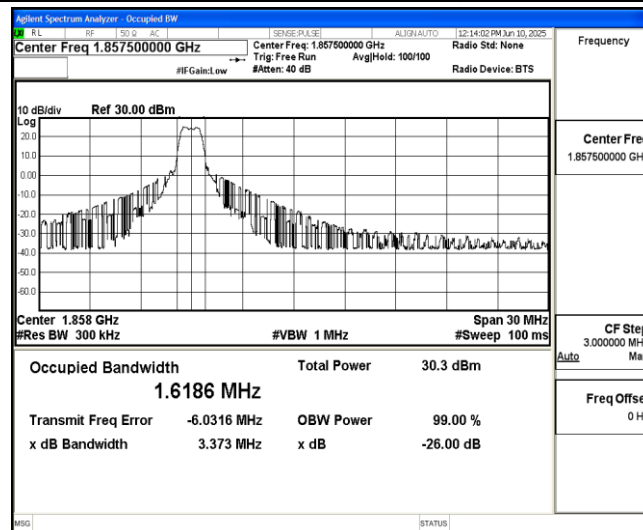


Band2-15MHz-16QAM-18675-6-0-Low-1.6186-3.373-PASS

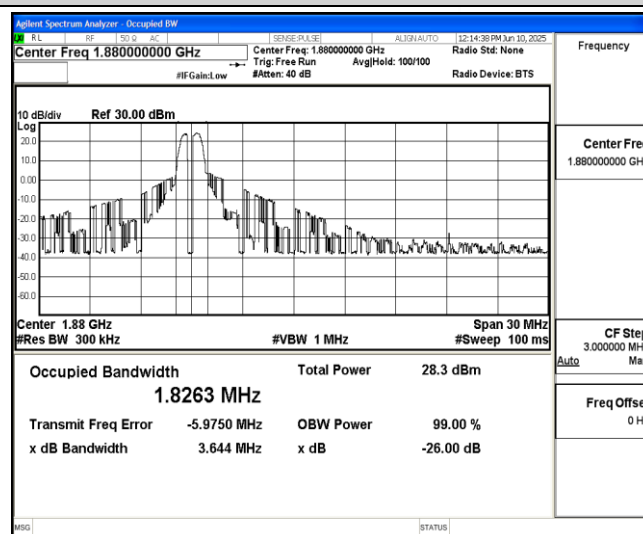


Band2-15MHz-16QAM-18900-6-0-Low-1.8263-3.644-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

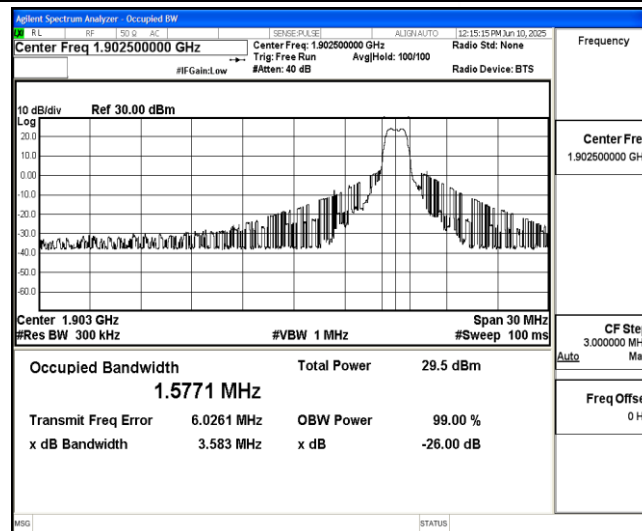

Band2-15MHz-16QAM-19125-6-0-High-1.5771-3.583-PASS

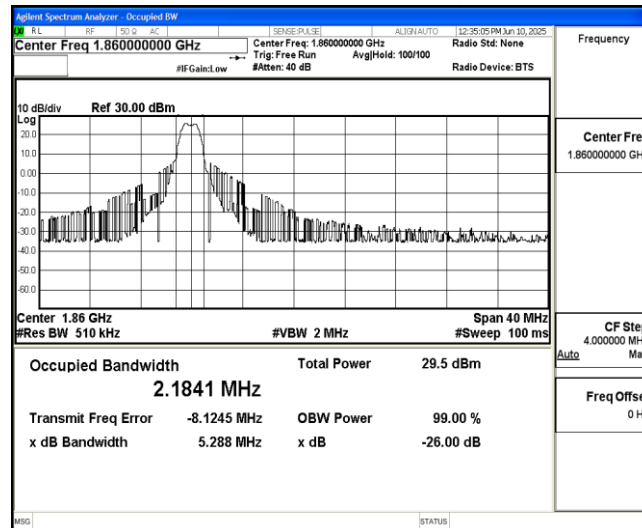


Band2-20MHz-QPSK-18700-6-0-Low-2.1841-5.288-PASS

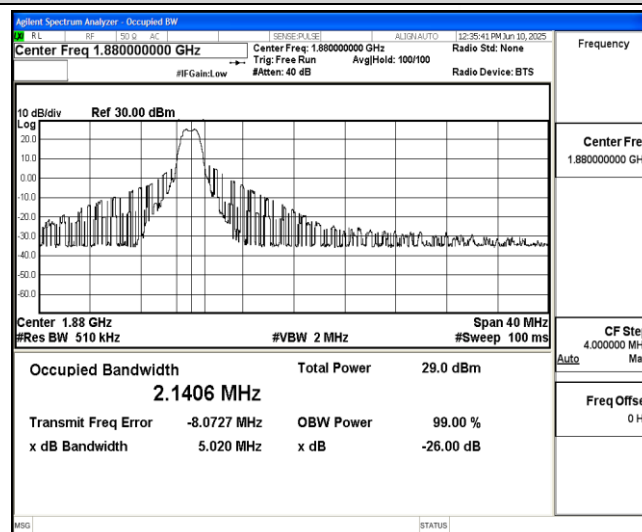


Band2-20MHz-QPSK-18900-6-0-Low-2.1406-5.020-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

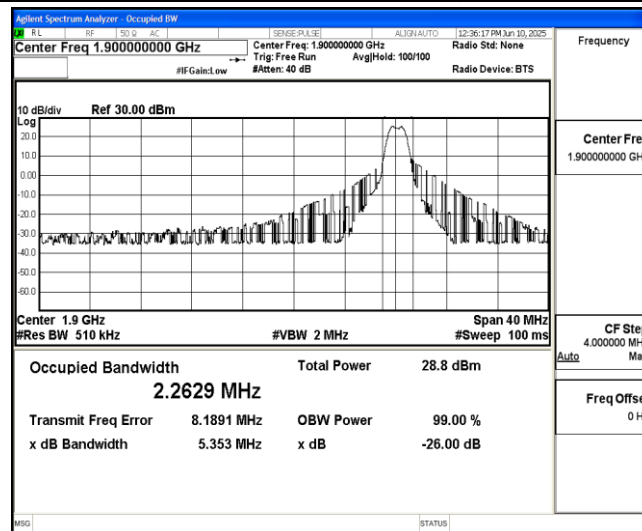

Band2-20MHz-QPSK-19100-6-0-High-2.2629-5.353-PASS

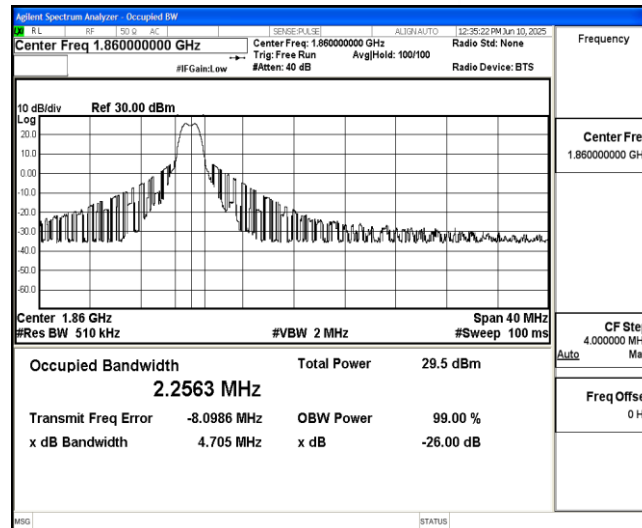


Band2-20MHz-16QAM-18700-6-0-Low-2.2563-4.705-PASS

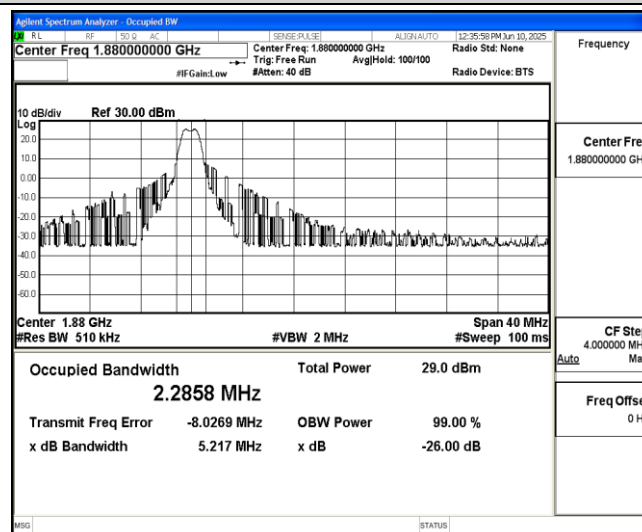

Band2-20MHz-16QAM-18900-6-0-Low-2.2858-5.217-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

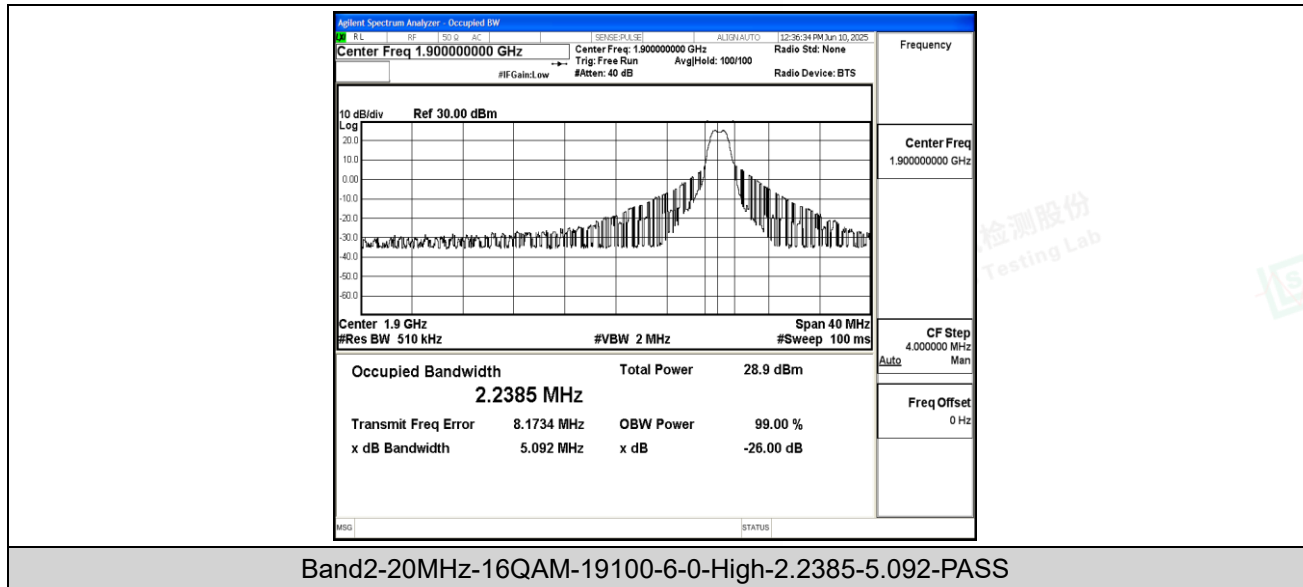



C.4 Band Edge for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Result(dBm)	Verdict
Band2	1.4MHz	18607	QPSK	1	0	Low	-24.93	PASS
Band2	1.4MHz	18607	QPSK	6	0	Low	-27.76	PASS
Band2	1.4MHz	19193	QPSK	1	0	High	-40.18	PASS
Band2	1.4MHz	19193	QPSK	6	0	High	-29.83	PASS
Band2	1.4MHz	18607	16QAM	1	0	Low	-23.89	PASS
Band2	1.4MHz	18607	16QAM	6	0	Low	-26.15	PASS
Band2	1.4MHz	19193	16QAM	1	0	High	-36.15	PASS
Band2	1.4MHz	19193	16QAM	6	0	High	-30.68	PASS
Band2	3MHz	18615	QPSK	1	0	Low	-28.28	PASS
Band2	3MHz	18615	QPSK	6	0	Low	-26.46	PASS
Band2	3MHz	19185	QPSK	1	0	High	-39.61	PASS
Band2	3MHz	19185	QPSK	6	0	High	-28.96	PASS
Band2	3MHz	18615	16QAM	1	0	Low	-30.80	PASS
Band2	3MHz	18615	16QAM	6	0	Low	-27.04	PASS
Band2	3MHz	19185	16QAM	1	0	High	-40.85	PASS
Band2	3MHz	19185	16QAM	6	0	High	-29.09	PASS
Band2	5MHz	18625	QPSK	1	0	Low	-23.96	PASS
Band2	5MHz	18625	QPSK	6	0	Low	-22.33	PASS
Band2	5MHz	19175	QPSK	1	0	High	-30.65	PASS
Band2	5MHz	19175	QPSK	6	0	High	-23.97	PASS
Band2	5MHz	18625	16QAM	1	0	Low	-20.99	PASS
Band2	5MHz	18625	16QAM	6	0	Low	-22.16	PASS
Band2	5MHz	19175	16QAM	1	0	High	-41.14	PASS
Band2	5MHz	19175	16QAM	6	0	High	-23.70	PASS
Band2	10MHz	18650	QPSK	1	0	Low	-31.00	PASS
Band2	10MHz	18650	QPSK	6	0	Low	-23.29	PASS
Band2	10MHz	19150	QPSK	1	0	High	-30.13	PASS
Band2	10MHz	19150	QPSK	6	0	High	-25.32	PASS
Band2	10MHz	18650	16QAM	1	0	Low	-32.62	PASS
Band2	10MHz	18650	16QAM	6	0	Low	-23.36	PASS
Band2	10MHz	19150	16QAM	1	0	High	-34.88	PASS
Band2	10MHz	19150	16QAM	6	0	High	-26.01	PASS
Band2	15MHz	18675	QPSK	1	0	Low	-31.18	PASS
Band2	15MHz	18675	QPSK	6	0	Low	-22.22	PASS





Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Band2	15MHz	19125	QPSK	1	0	High	-28.95	PASS
Band2	15MHz	19125	QPSK	6	0	High	-25.94	PASS
Band2	15MHz	18675	16QAM	1	0	Low	-32.71	PASS
Band2	15MHz	18675	16QAM	6	0	Low	-21.99	PASS
Band2	15MHz	19125	16QAM	1	0	High	-31.62	PASS
Band2	15MHz	19125	16QAM	6	0	High	-25.79	PASS
Band2	20MHz	18700	QPSK	1	0	Low	-28.50	PASS
Band2	20MHz	18700	QPSK	6	0	Low	-25.59	PASS
Band2	20MHz	19100	QPSK	1	0	High	-28.61	PASS
Band2	20MHz	19100	QPSK	6	0	High	-27.60	PASS
Band2	20MHz	18700	16QAM	1	0	Low	-33.15	PASS
Band2	20MHz	18700	16QAM	6	0	Low	-25.66	PASS
Band2	20MHz	19100	16QAM	1	0	High	-33.12	PASS
Band2	20MHz	19100	16QAM	6	0	High	-26.30	PASS

Test Graphs

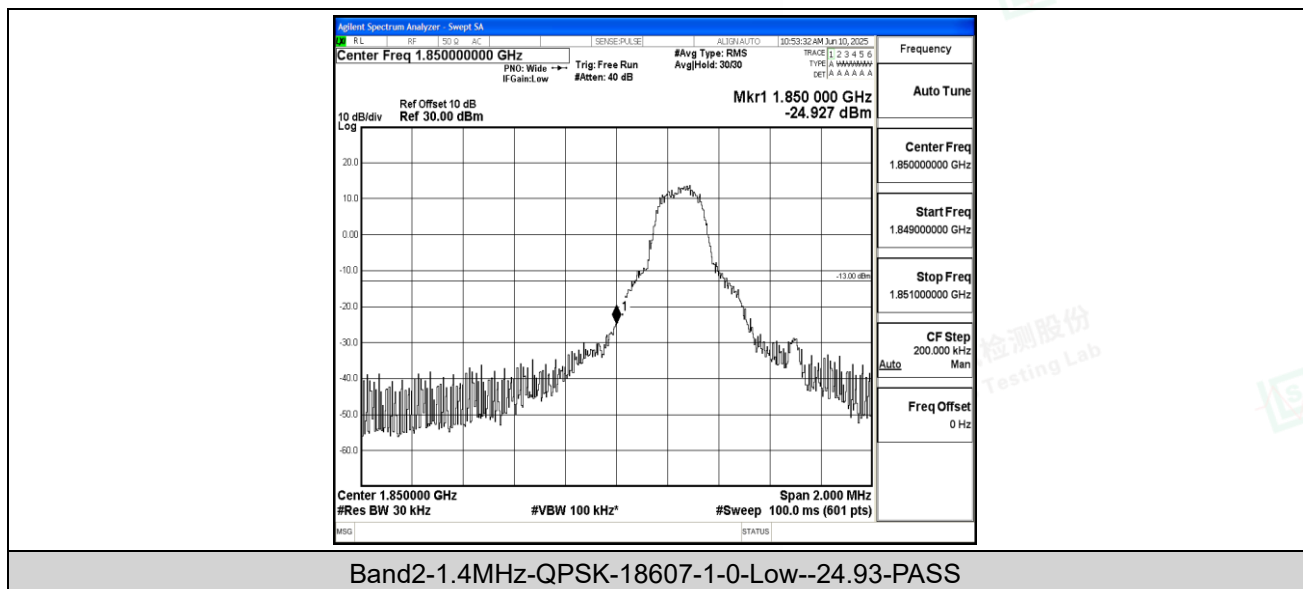


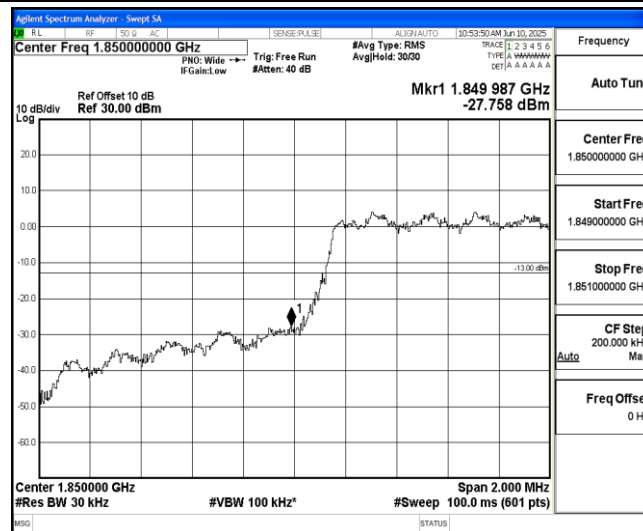

Band2-1.4MHz-QPSK-18607-6-0-Low--27.76-PASS

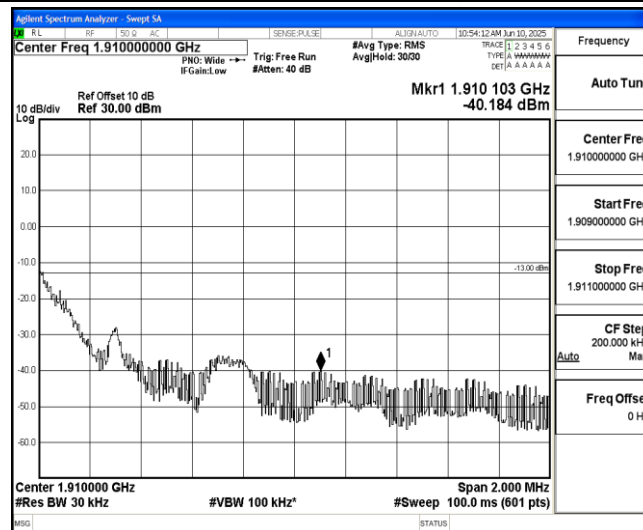


Band2-1.4MHz-QPSK-19193-1-0-High--40.18-PASS

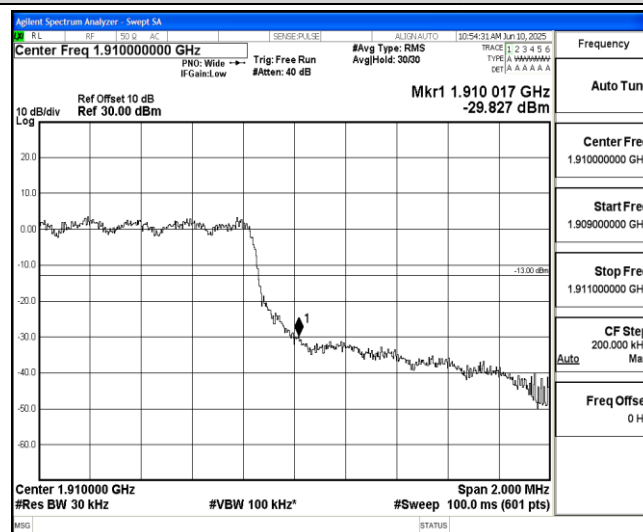


Band2-1.4MHz-QPSK-19193-6-0-High--29.83-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

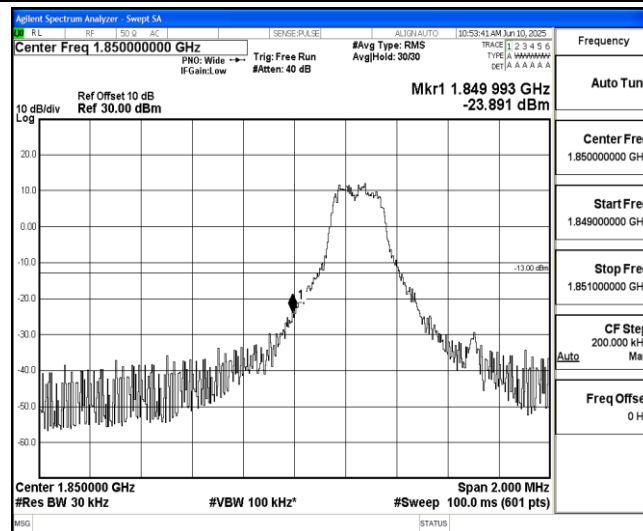

Band2-1.4MHz-16QAM-18607-1-0-Low--23.89-PASS

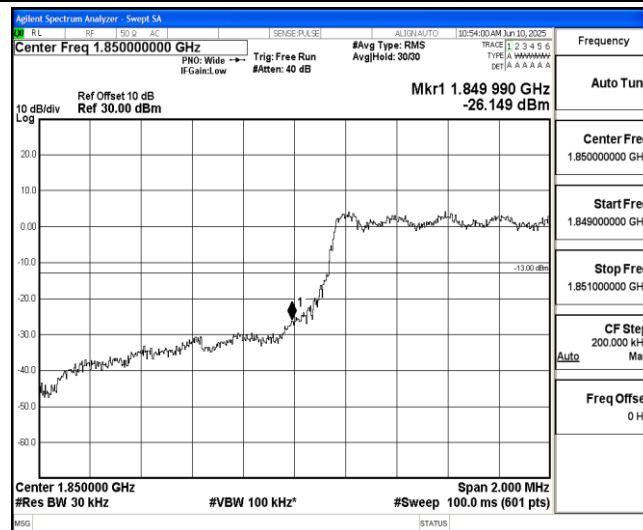


Band2-1.4MHz-16QAM-18607-6-0-Low--26.15-PASS

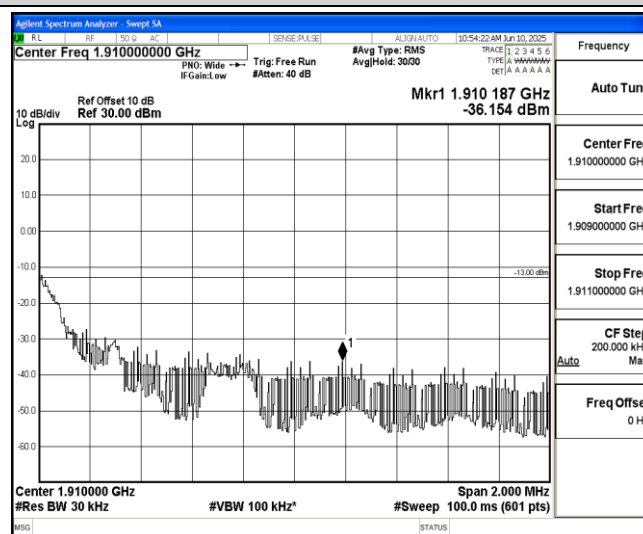


Band2-1.4MHz-16QAM-19193-1-0-High--36.15-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

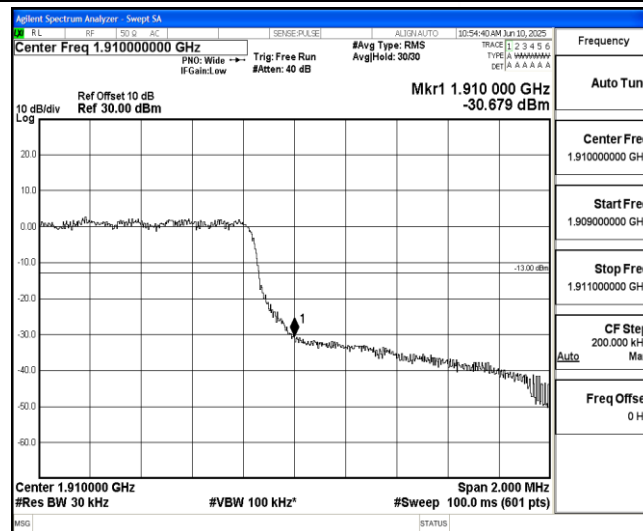

Band2-1.4MHz-16QAM-19193-6-0-High--30.68-PASS

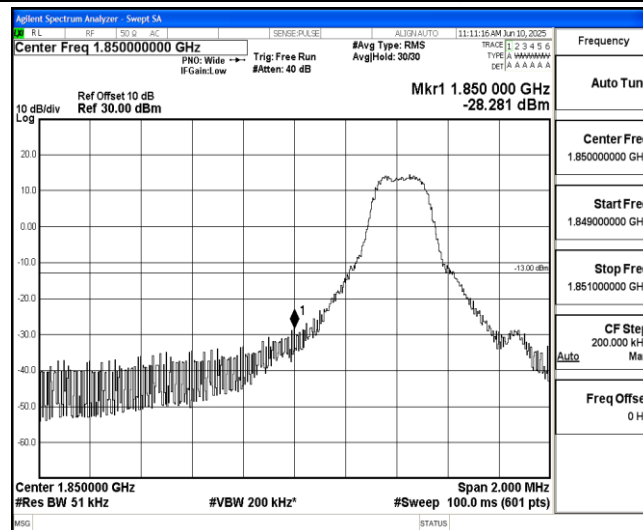


Band2-3MHz-QPSK-18615-1-0-Low--28.28-PASS

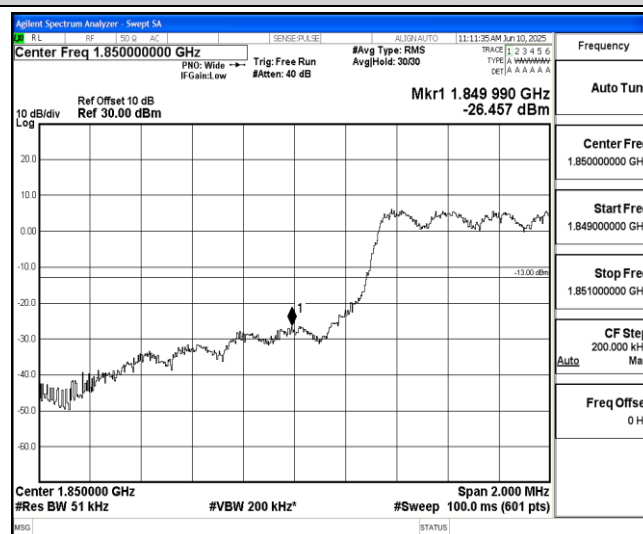


Band2-3MHz-QPSK-18615-6-0-Low--26.46-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

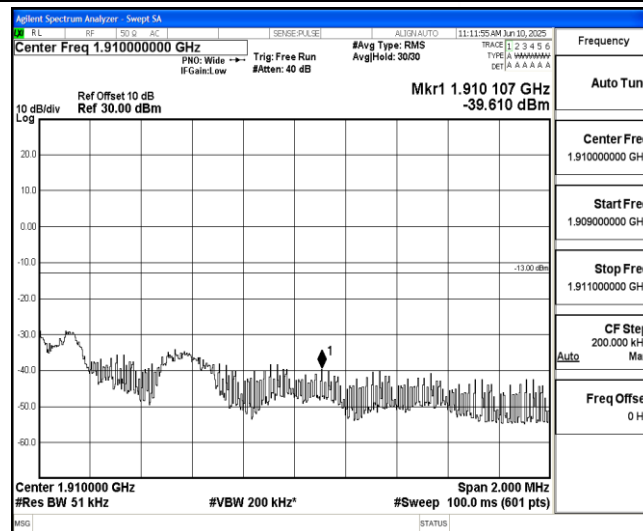

Band2-3MHz-QPSK-19185-1-0-High--39.61-PASS

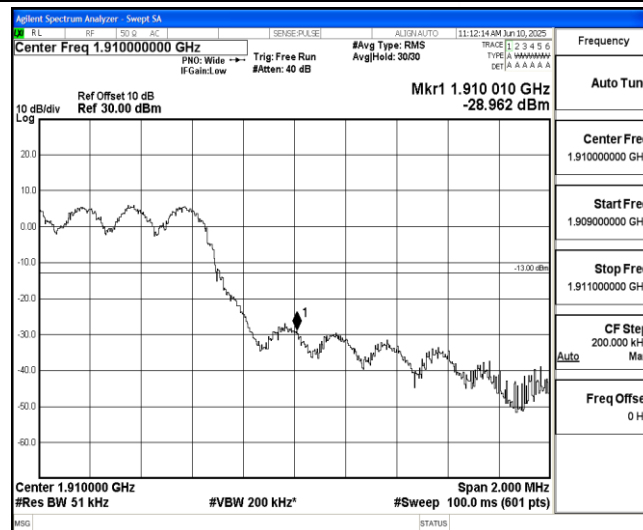


Band2-3MHz-QPSK-19185-6-0-High--28.96-PASS

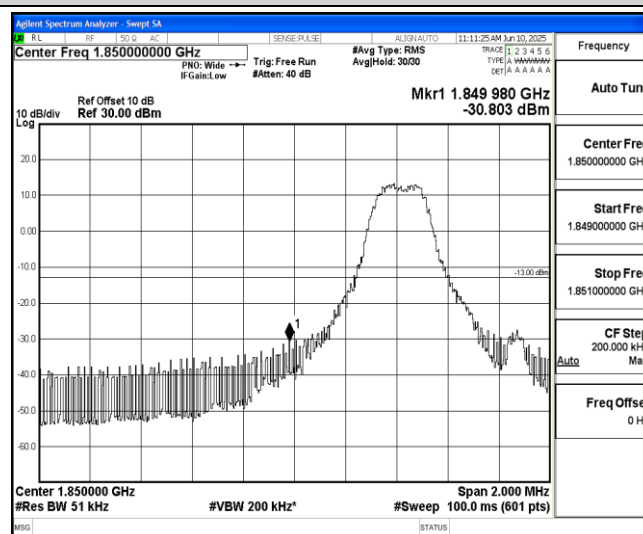


Band2-3MHz-16QAM-18615-1-0-Low--30.80-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

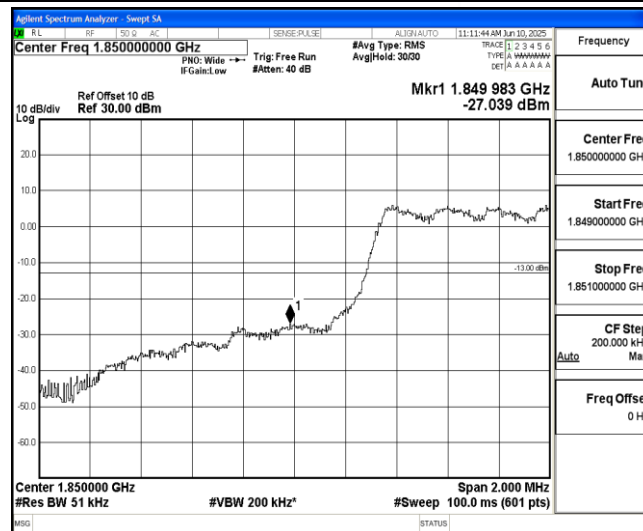

Band2-3MHz-16QAM-18615-6-0-Low--27.04-PASS

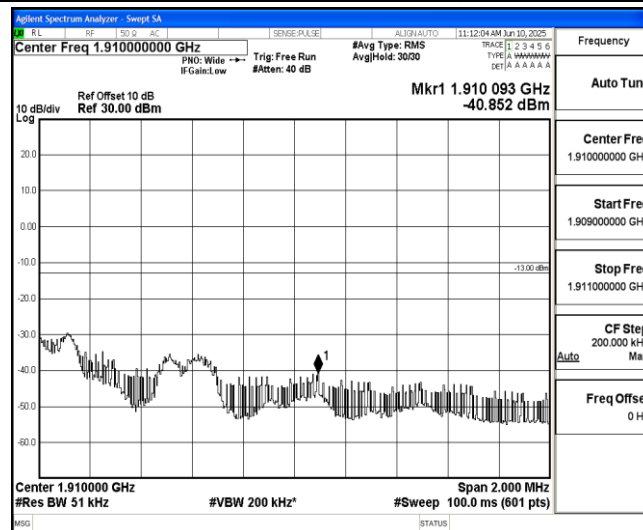


Band2-3MHz-16QAM-19185-1-0-High--40.85-PASS

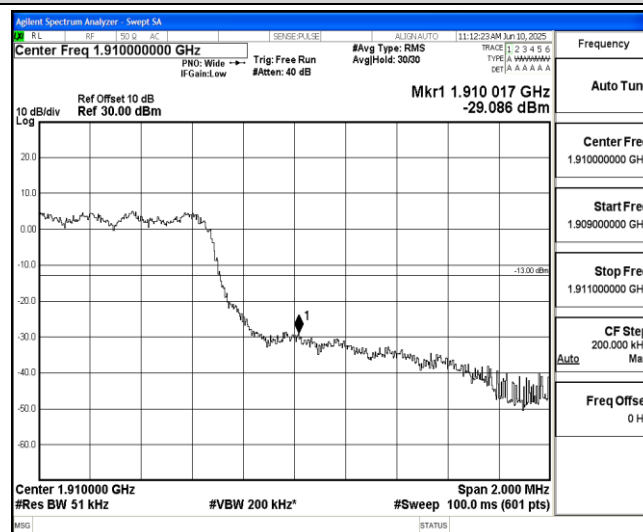


Band2-3MHz-16QAM-19185-6-0-High--29.09-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

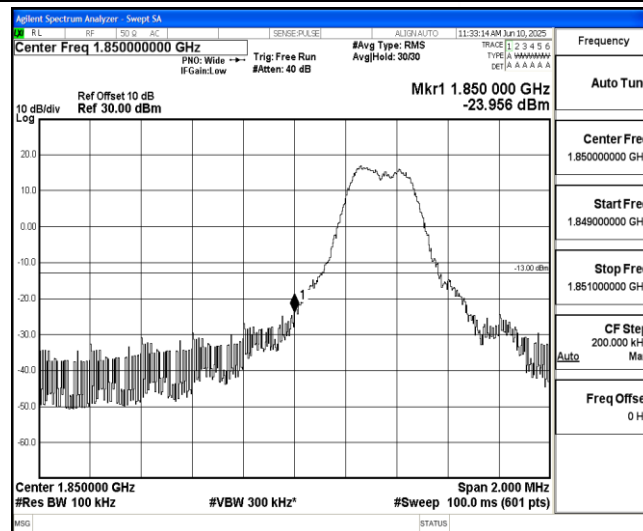

Band2-5MHz-QPSK-18625-1-0-Low--23.96-PASS

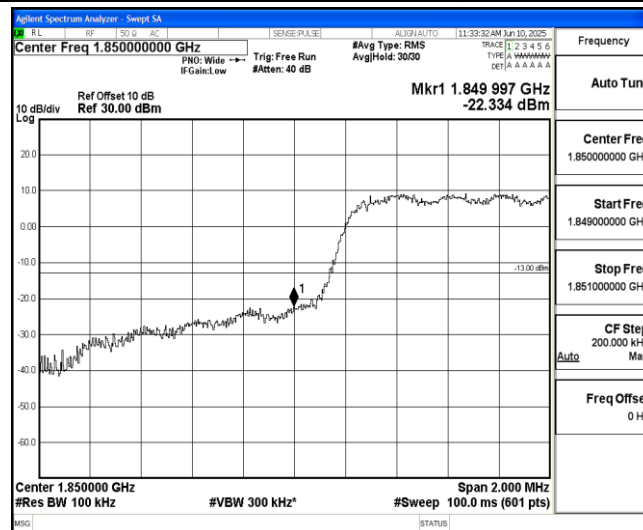


Band2-5MHz-QPSK-18625-6-0-Low--22.33-PASS

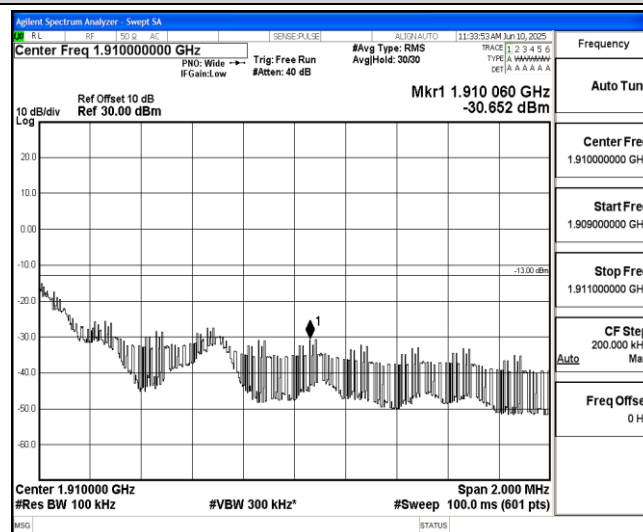


Band2-5MHz-QPSK-19175-1-0-High--30.65-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

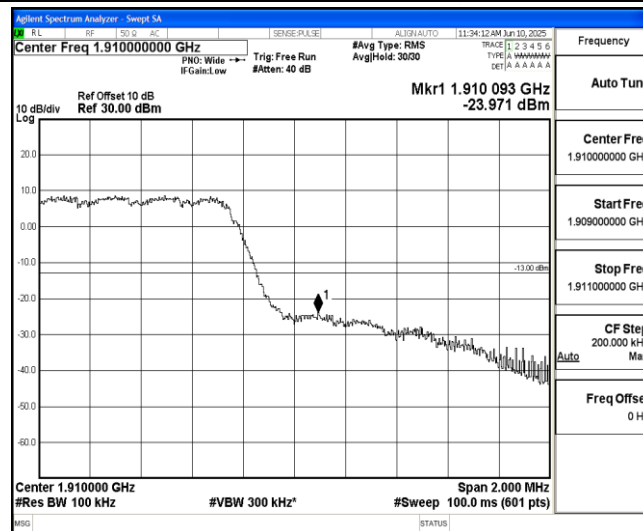

Band2-5MHz-QPSK-19175-6-0-High--23.97-PASS

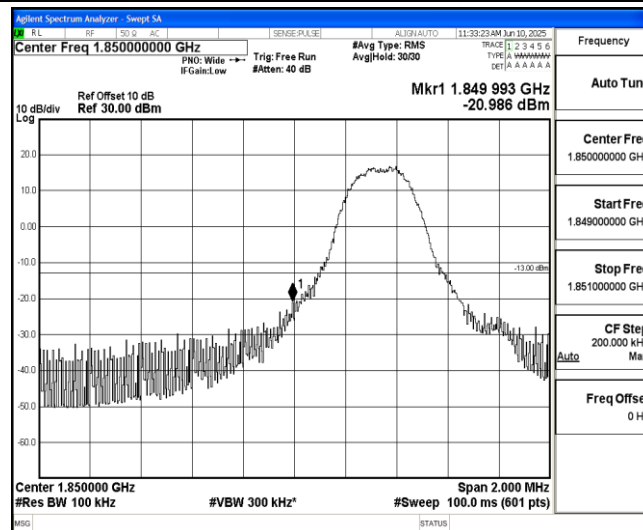


Band2-5MHz-16QAM-18625-1-0-Low--20.99-PASS

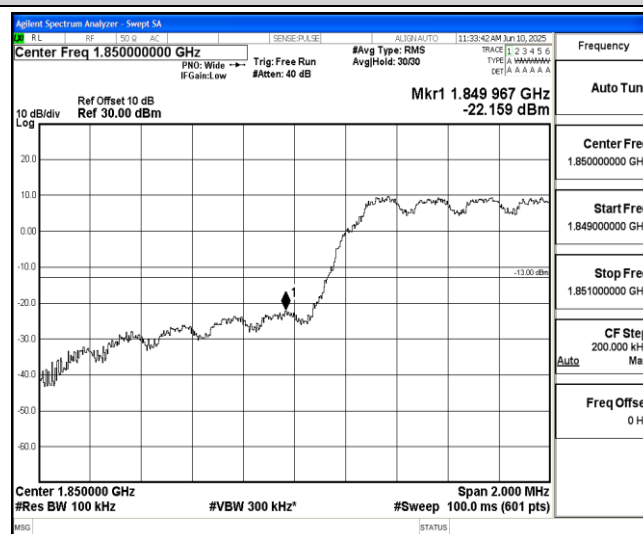


Band2-5MHz-16QAM-18625-6-0-Low--22.16-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

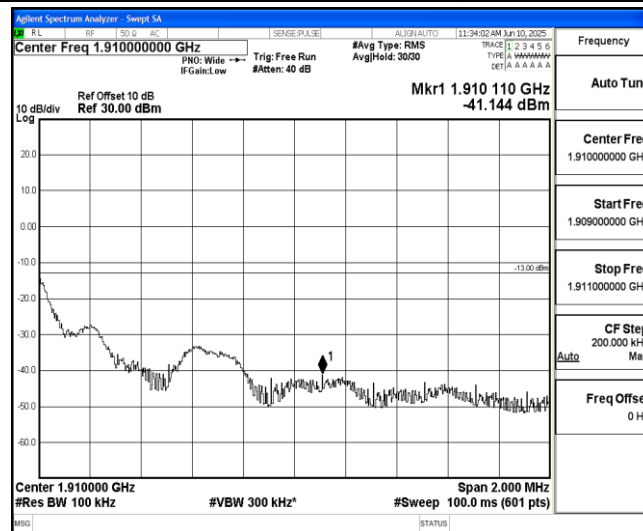

Band2-5MHz-16QAM-19175-1-0-High--41.14-PASS

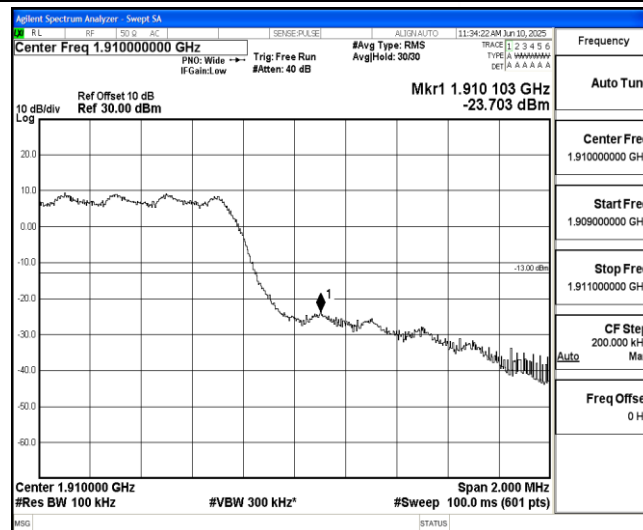


Band2-5MHz-16QAM-19175-6-0-High--23.70-PASS

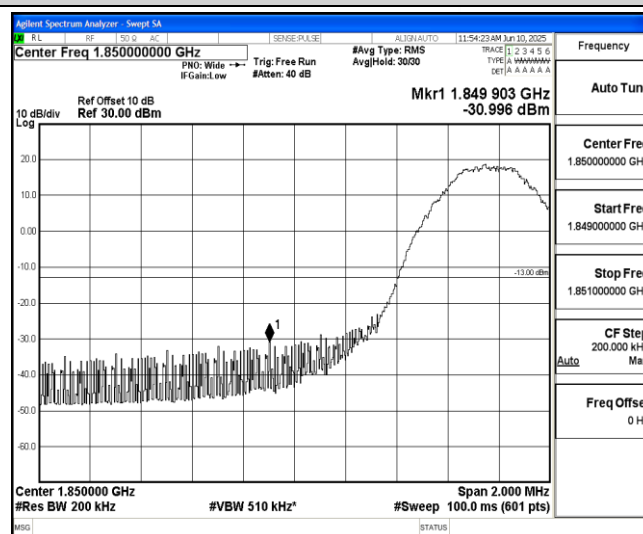


Band2-10MHz-QPSK-18650-1-0-Low--31.00-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

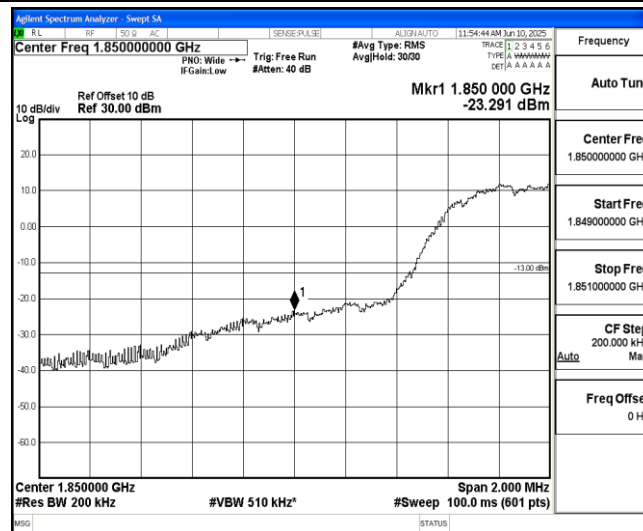

Band2-10MHz-QPSK-18650-6-0-Low--23.29-PASS

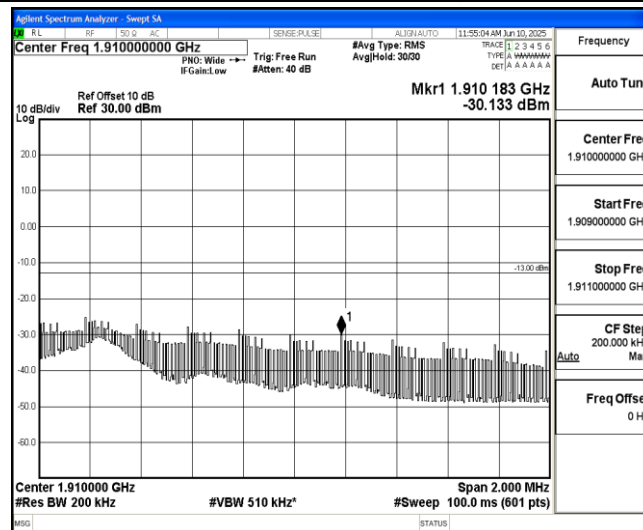


Band2-10MHz-QPSK-19150-1-0-High--30.13-PASS

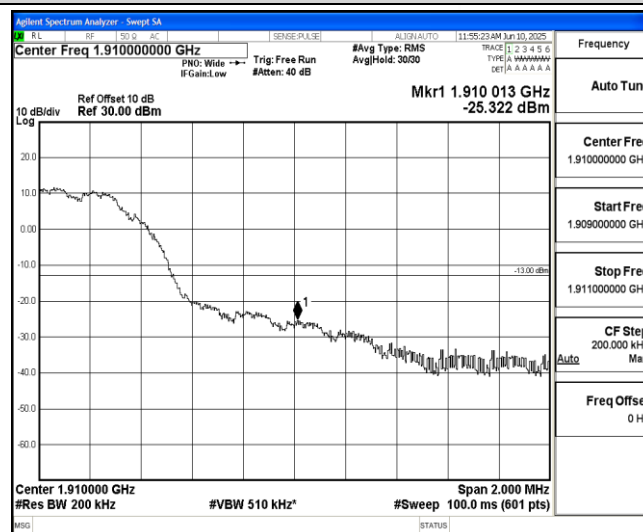


Band2-10MHz-QPSK-19150-6-0-High--25.32-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

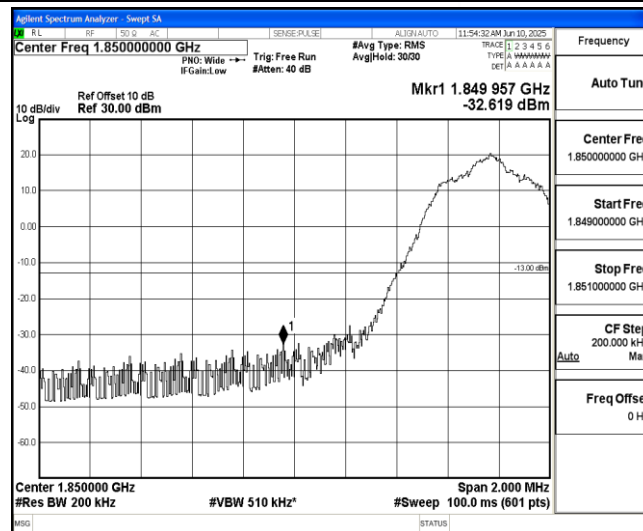

Band2-10MHz-16QAM-18650-1-0-Low--32.62-PASS

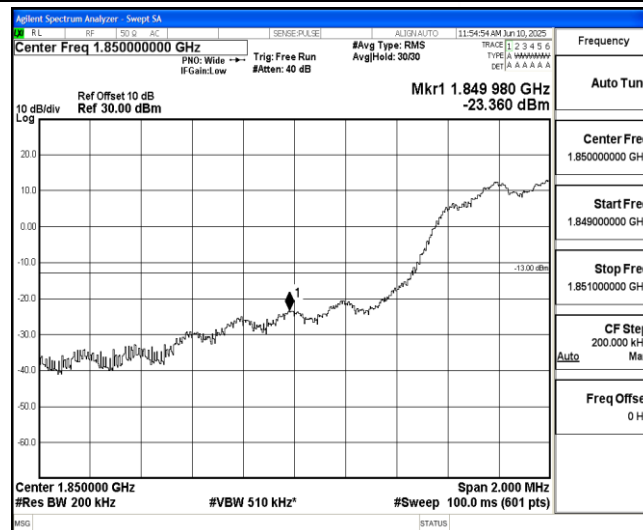


Band2-10MHz-16QAM-18650-6-0-Low--23.36-PASS

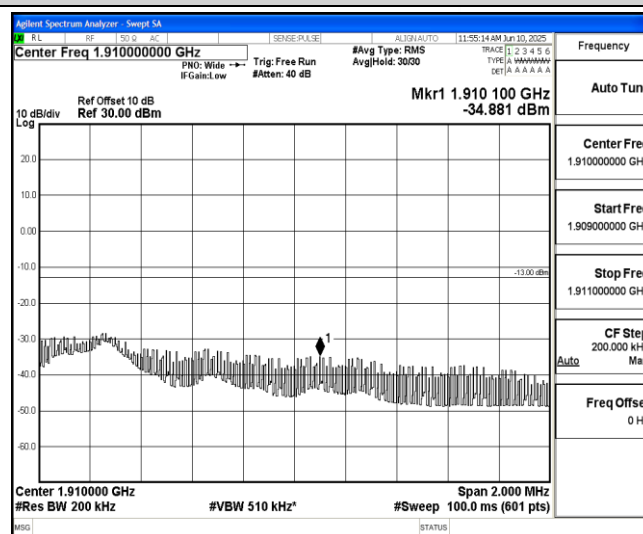


Band2-10MHz-16QAM-19150-1-0-High--34.88-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

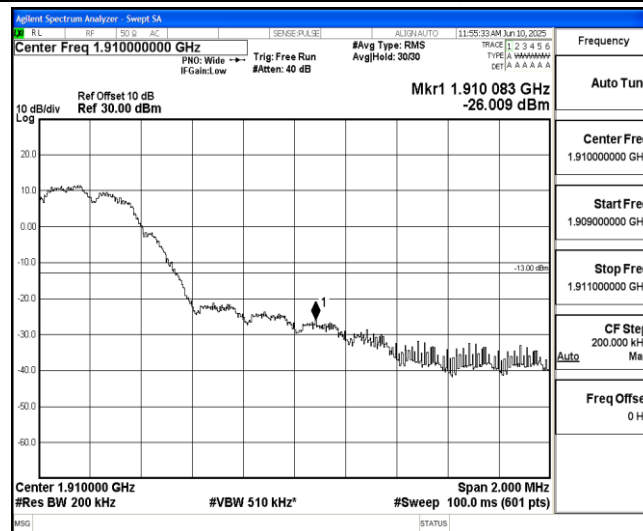

Band2-10MHz-16QAM-19150-6-0-High--26.01-PASS

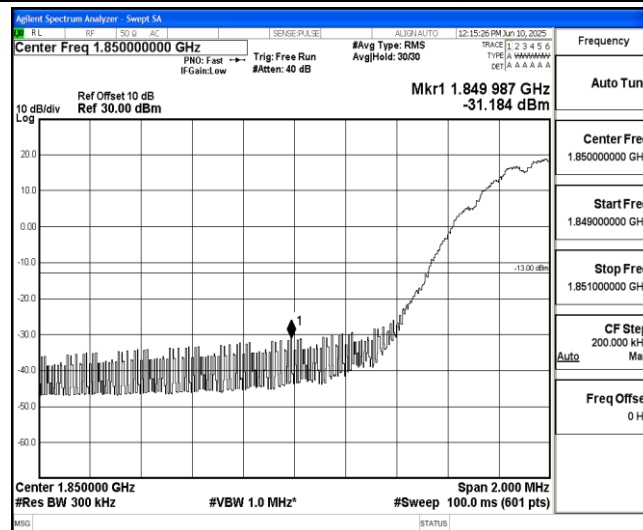


Band2-15MHz-QPSK-18675-1-0-Low--31.18-PASS

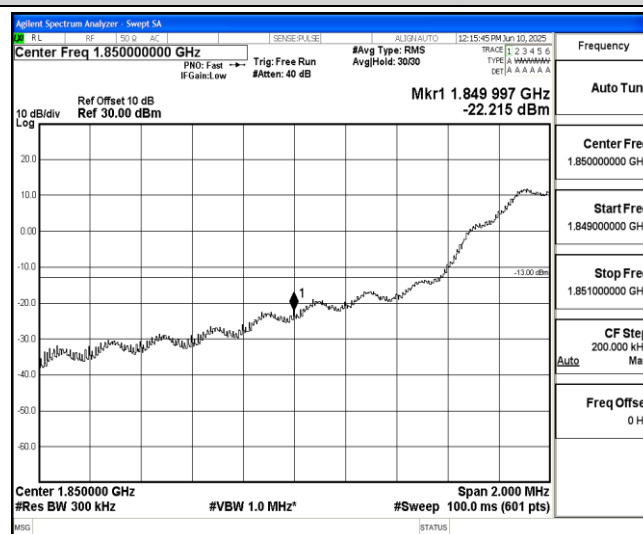


Band2-15MHz-QPSK-18675-6-0-Low--22.22-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

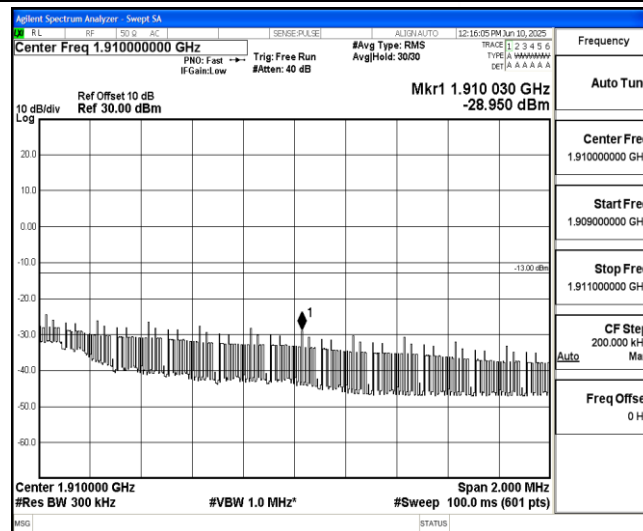

Band2-15MHz-QPSK-19125-1-0-High--28.95-PASS

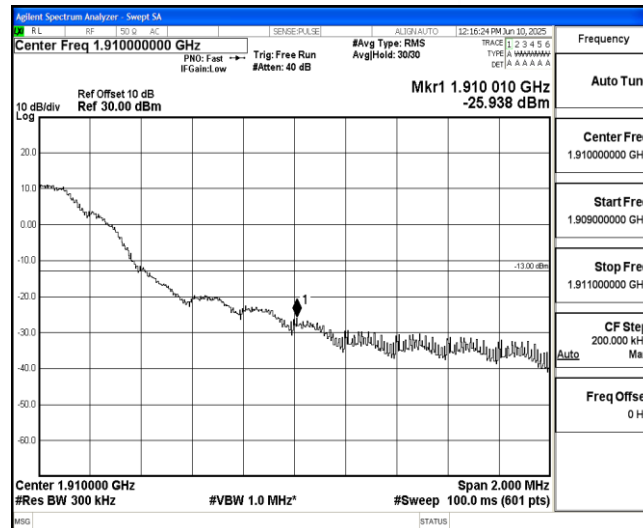


Band2-15MHz-QPSK-19125-6-0-High--25.94-PASS

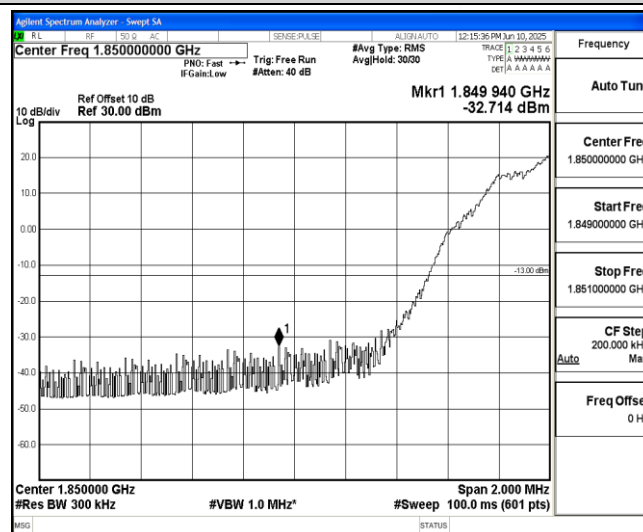


Band2-15MHz-16QAM-18675-1-0-Low--32.71-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

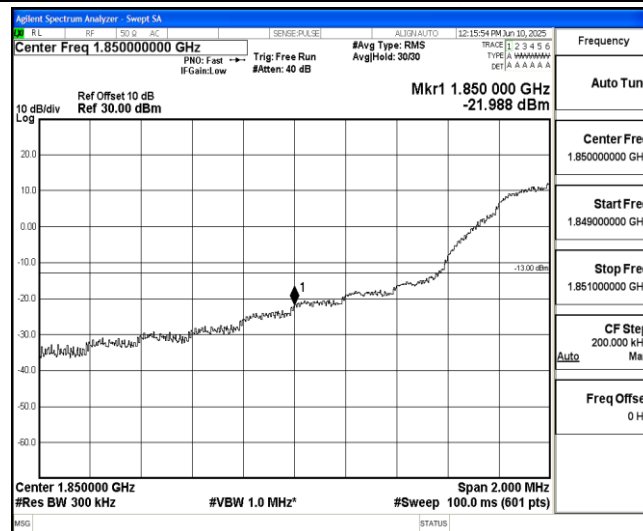

Band2-15MHz-16QAM-18675-6-0-Low--21.99-PASS

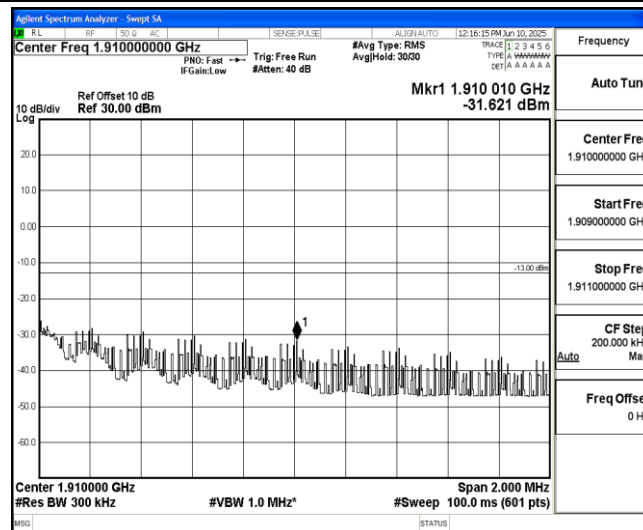


Band2-15MHz-16QAM-19125-1-0-High--31.62-PASS

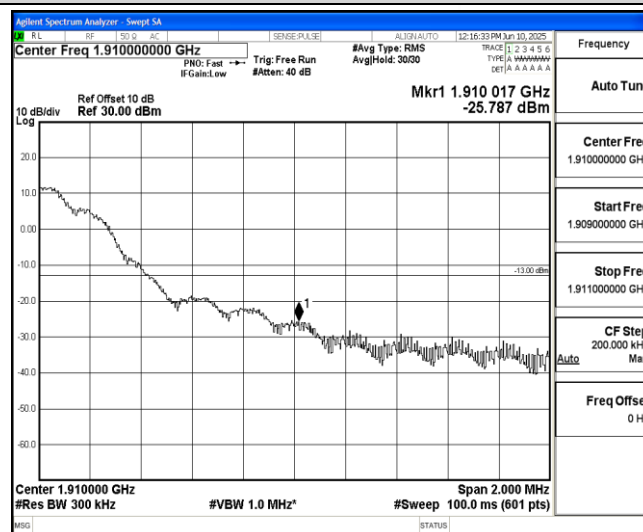


Band2-15MHz-16QAM-19125-6-0-High--25.79-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

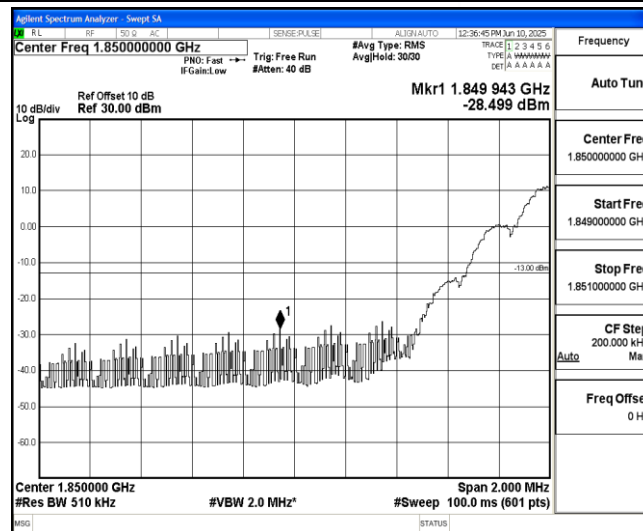

Band2-20MHz-QPSK-18700-1-0-Low--28.50-PASS

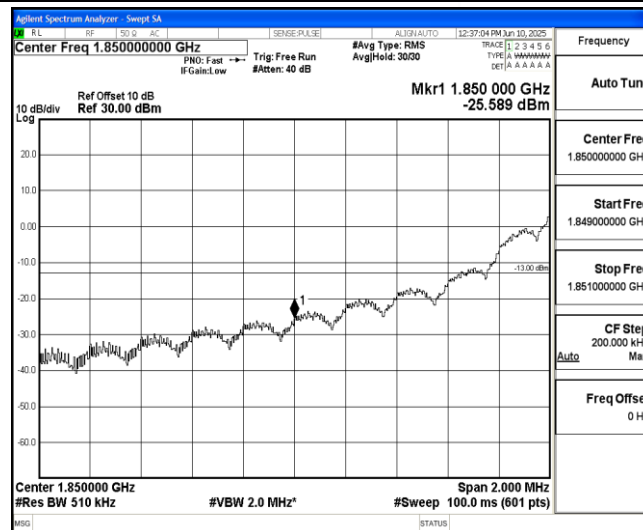


Band2-20MHz-QPSK-18700-6-0-Low--25.59-PASS

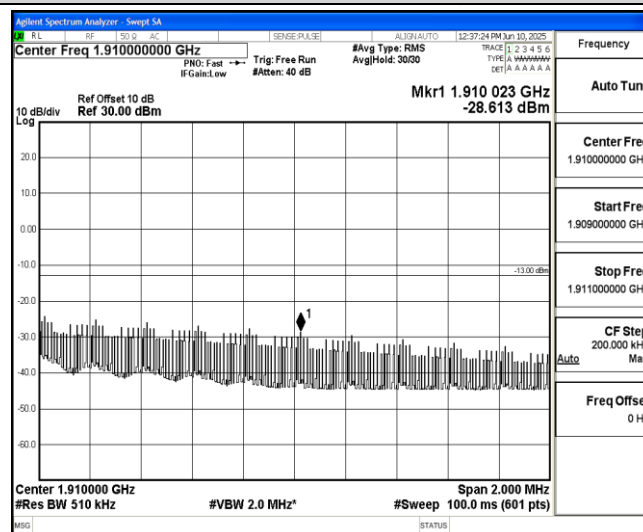


Band2-20MHz-QPSK-19100-1-0-High--28.61-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

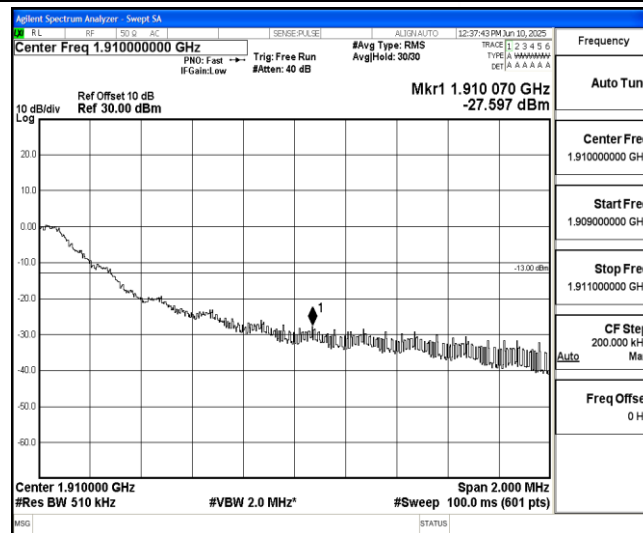

Band2-20MHz-QPSK-19100-6-0-High--27.60-PASS

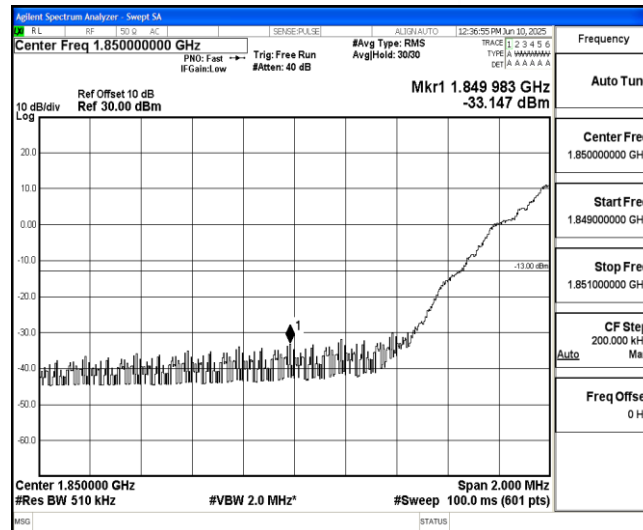


Band2-20MHz-16QAM-18700-1-0-Low--33.15-PASS

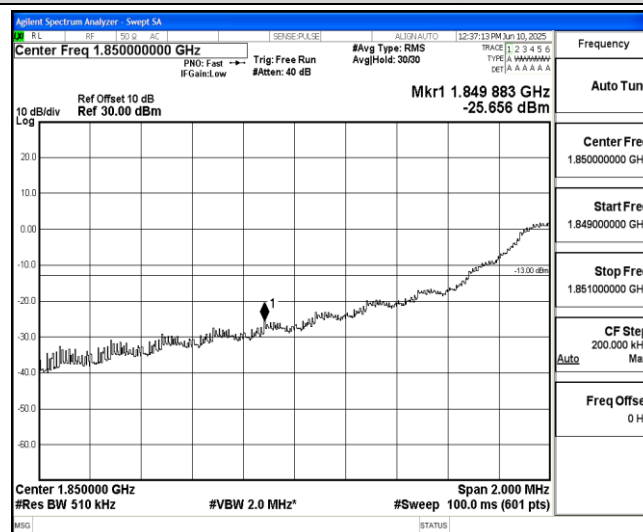


Band2-20MHz-16QAM-18700-6-0-Low--25.66-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

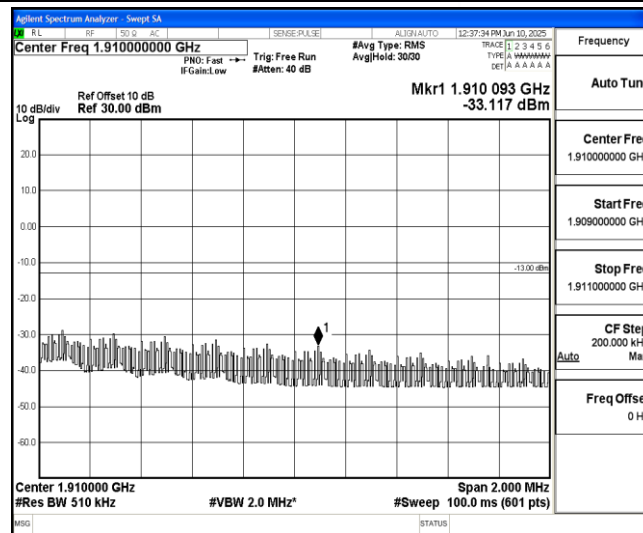

Band2-20MHz-16QAM-19100-1-0-High--33.12-PASS

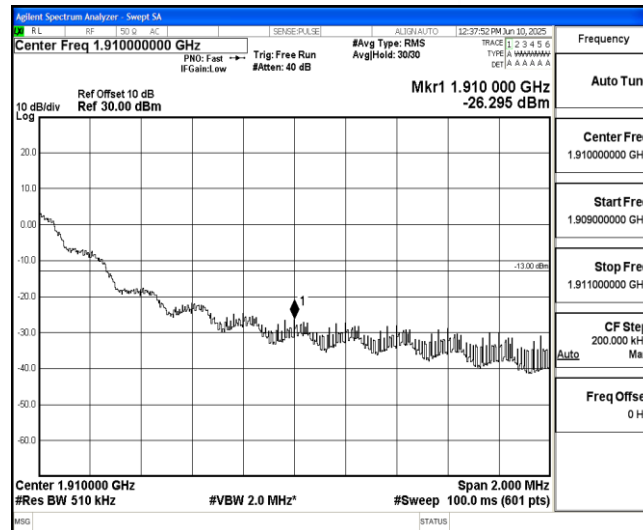

Band2-20MHz-16QAM-19100-6-0-High--26.30-PASS





C.5 Conducted Spurious Emission for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Start Freq	Stop Freq	Result (dBm)	Verdict
Band2	1.4MHz	18607	QPSK	1	0	Low	30	1000	-33.77	PASS
Band2	1.4MHz	18607	QPSK	1	0	Low	1000	5000	-33.87	PASS
Band2	1.4MHz	18607	QPSK	1	0	Low	5000	12000	-56.21	PASS
Band2	1.4MHz	18607	QPSK	1	0	Low	12000	26500	-41.36	PASS
Band2	1.4MHz	18900	QPSK	1	0	Low	30	1000	-34.21	PASS
Band2	1.4MHz	18900	QPSK	1	0	Low	1000	5000	-32.21	PASS
Band2	1.4MHz	18900	QPSK	1	0	Low	5000	12000	-56.11	PASS
Band2	1.4MHz	18900	QPSK	1	0	Low	12000	26500	-41.17	PASS
Band2	1.4MHz	19193	QPSK	1	0	High	30	1000	-34.43	PASS
Band2	1.4MHz	19193	QPSK	1	0	High	1000	5000	-30.83	PASS
Band2	1.4MHz	19193	QPSK	1	0	High	5000	12000	-56.03	PASS
Band2	1.4MHz	19193	QPSK	1	0	High	12000	26500	-41.06	PASS
Band2	1.4MHz	18607	16QAM	1	0	Low	30	1000	-34.45	PASS
Band2	1.4MHz	18607	16QAM	1	0	Low	1000	5000	-33.5	PASS
Band2	1.4MHz	18607	16QAM	1	0	Low	5000	12000	-56.35	PASS
Band2	1.4MHz	18607	16QAM	1	0	Low	12000	26500	-41.12	PASS
Band2	1.4MHz	18900	16QAM	1	0	Low	30	1000	-34.56	PASS
Band2	1.4MHz	18900	16QAM	1	0	Low	1000	5000	-33.37	PASS
Band2	1.4MHz	18900	16QAM	1	0	Low	5000	12000	-56.2	PASS
Band2	1.4MHz	18900	16QAM	1	0	Low	12000	26500	-41.16	PASS
Band2	1.4MHz	19193	16QAM	1	0	High	30	1000	-33.87	PASS
Band2	1.4MHz	19193	16QAM	1	0	High	1000	5000	-31.12	PASS
Band2	1.4MHz	19193	16QAM	1	0	High	5000	12000	-56.1	PASS
Band2	1.4MHz	19193	16QAM	1	0	High	12000	26500	-41.18	PASS
Band2	3MHz	18615	QPSK	1	0	Low	30	1000	-33.92	PASS
Band2	3MHz	18615	QPSK	1	0	Low	1000	5000	-32.67	PASS
Band2	3MHz	18615	QPSK	1	0	Low	5000	12000	-56.21	PASS
Band2	3MHz	18615	QPSK	1	0	Low	12000	26500	-41.23	PASS
Band2	3MHz	18900	QPSK	1	0	Low	30	1000	-33.92	PASS
Band2	3MHz	18900	QPSK	1	0	Low	1000	5000	-32.62	PASS
Band2	3MHz	18900	QPSK	1	0	Low	5000	12000	-56.12	PASS
Band2	3MHz	18900	QPSK	1	0	Low	12000	26500	-41.24	PASS
Band2	3MHz	19185	QPSK	1	0	High	30	1000	-33.66	PASS
Band2	3MHz	19185	QPSK	1	0	High	1000	5000	-30.88	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Band2	3MHz	19185	QPSK	1	0	High	5000	12000	-56.21	PASS
Band2	3MHz	19185	QPSK	1	0	High	12000	26500	-40.89	PASS
Band2	3MHz	18615	16QAM	1	0	Low	30	1000	-34.42	PASS
Band2	3MHz	18615	16QAM	1	0	Low	1000	5000	-33.64	PASS
Band2	3MHz	18615	16QAM	1	0	Low	5000	12000	-56.18	PASS
Band2	3MHz	18615	16QAM	1	0	Low	12000	26500	-41.23	PASS
Band2	3MHz	18900	16QAM	1	0	Low	30	1000	-33.9	PASS
Band2	3MHz	18900	16QAM	1	0	Low	1000	5000	-38.42	PASS
Band2	3MHz	18900	16QAM	1	0	Low	5000	12000	-56.27	PASS
Band2	3MHz	18900	16QAM	1	0	Low	12000	26500	-41.13	PASS
Band2	3MHz	19185	16QAM	1	0	High	30	1000	-34.34	PASS
Band2	3MHz	19185	16QAM	1	0	High	1000	5000	-32.3	PASS
Band2	3MHz	19185	16QAM	1	0	High	5000	12000	-56.04	PASS
Band2	3MHz	19185	16QAM	1	0	High	12000	26500	-41.17	PASS
Band2	5MHz	18625	QPSK	1	0	Low	30	1000	-33.83	PASS
Band2	5MHz	18625	QPSK	1	0	Low	1000	5000	-32.98	PASS
Band2	5MHz	18625	QPSK	1	0	Low	5000	12000	-56.4	PASS
Band2	5MHz	18625	QPSK	1	0	Low	12000	26500	-41.26	PASS
Band2	5MHz	18900	QPSK	1	0	Low	30	1000	-34.46	PASS
Band2	5MHz	18900	QPSK	1	0	Low	1000	5000	-32.5	PASS
Band2	5MHz	18900	QPSK	1	0	Low	5000	12000	-55.94	PASS
Band2	5MHz	18900	QPSK	1	0	Low	12000	26500	-41.2	PASS
Band2	5MHz	19175	QPSK	1	0	High	30	1000	-33.84	PASS
Band2	5MHz	19175	QPSK	1	0	High	1000	5000	-30.68	PASS
Band2	5MHz	19175	QPSK	1	0	High	5000	12000	-56.08	PASS
Band2	5MHz	19175	QPSK	1	0	High	12000	26500	-41.24	PASS
Band2	5MHz	18625	16QAM	1	0	Low	30	1000	-33.78	PASS
Band2	5MHz	18625	16QAM	1	0	Low	1000	5000	-32.62	PASS
Band2	5MHz	18625	16QAM	1	0	Low	5000	12000	-56.21	PASS
Band2	5MHz	18625	16QAM	1	0	Low	12000	26500	-41.19	PASS
Band2	5MHz	18900	16QAM	1	0	Low	30	1000	-33.83	PASS
Band2	5MHz	18900	16QAM	1	0	Low	1000	5000	-32.24	PASS
Band2	5MHz	18900	16QAM	1	0	Low	5000	12000	-56.09	PASS
Band2	5MHz	18900	16QAM	1	0	Low	12000	26500	-41.24	PASS
Band2	5MHz	19175	16QAM	1	0	High	30	1000	-34.29	PASS
Band2	5MHz	19175	16QAM	1	0	High	1000	5000	-30.39	PASS
Band2	5MHz	19175	16QAM	1	0	High	5000	12000	-56.2	PASS
Band2	5MHz	19175	16QAM	1	0	High	12000	26500	-41.28	PASS
Band2	10MHz	18650	QPSK	1	0	Low	30	1000	-34.67	PASS
Band2	10MHz	18650	QPSK	1	0	Low	1000	5000	-32.87	PASS





Band2	10MHz	18650	QPSK	1	0	Low	5000	12000	-56.01	PASS
Band2	10MHz	18650	QPSK	1	0	Low	12000	26500	-41.06	PASS
Band2	10MHz	18900	QPSK	1	0	Low	30	1000	-34.62	PASS
Band2	10MHz	18900	QPSK	1	0	Low	1000	5000	-33.09	PASS
Band2	10MHz	18900	QPSK	1	0	Low	5000	12000	-56.33	PASS
Band2	10MHz	18900	QPSK	1	0	Low	12000	26500	-41.34	PASS
Band2	10MHz	19150	QPSK	1	0	High	30	1000	-34.05	PASS
Band2	10MHz	19150	QPSK	1	0	High	1000	5000	-30.93	PASS
Band2	10MHz	19150	QPSK	1	0	High	5000	12000	-56.16	PASS
Band2	10MHz	19150	QPSK	1	0	High	12000	26500	-41.3	PASS
Band2	10MHz	18650	16QAM	1	0	Low	30	1000	-33.69	PASS
Band2	10MHz	18650	16QAM	1	0	Low	1000	5000	-32.8	PASS
Band2	10MHz	18650	16QAM	1	0	Low	5000	12000	-56.02	PASS
Band2	10MHz	18650	16QAM	1	0	Low	12000	26500	-41.36	PASS
Band2	10MHz	18900	16QAM	1	0	Low	30	1000	-34.28	PASS
Band2	10MHz	18900	16QAM	1	0	Low	1000	5000	-33.1	PASS
Band2	10MHz	18900	16QAM	1	0	Low	5000	12000	-56.27	PASS
Band2	10MHz	18900	16QAM	1	0	Low	12000	26500	-41.15	PASS
Band2	10MHz	19150	16QAM	1	0	High	30	1000	-34.62	PASS
Band2	10MHz	19150	16QAM	1	0	High	1000	5000	-31.02	PASS
Band2	10MHz	19150	16QAM	1	0	High	5000	12000	-56.09	PASS
Band2	10MHz	19150	16QAM	1	0	High	12000	26500	-41.04	PASS
Band2	15MHz	18675	QPSK	1	0	Low	30	1000	-34.4	PASS
Band2	15MHz	18675	QPSK	1	0	Low	1000	5000	-32.99	PASS
Band2	15MHz	18675	QPSK	1	0	Low	5000	12000	-56.31	PASS
Band2	15MHz	18675	QPSK	1	0	Low	12000	26500	-41	PASS
Band2	15MHz	18900	QPSK	1	0	Low	30	1000	-33.84	PASS
Band2	15MHz	18900	QPSK	1	0	Low	1000	5000	-32.96	PASS
Band2	15MHz	18900	QPSK	1	0	Low	5000	12000	-56.05	PASS
Band2	15MHz	18900	QPSK	1	0	Low	12000	26500	-41.19	PASS
Band2	15MHz	19125	QPSK	1	0	High	30	1000	-34.52	PASS
Band2	15MHz	19125	QPSK	1	0	High	1000	5000	-30.86	PASS
Band2	15MHz	19125	QPSK	1	0	High	5000	12000	-56.19	PASS
Band2	15MHz	19125	QPSK	1	0	High	12000	26500	-41.23	PASS
Band2	15MHz	18675	16QAM	1	0	Low	30	1000	-33.98	PASS
Band2	15MHz	18675	16QAM	1	0	Low	1000	5000	-32.69	PASS
Band2	15MHz	18675	16QAM	1	0	Low	5000	12000	-56.21	PASS
Band2	15MHz	18675	16QAM	1	0	Low	12000	26500	-41.18	PASS
Band2	15MHz	18900	16QAM	1	0	Low	30	1000	-33.77	PASS
Band2	15MHz	18900	16QAM	1	0	Low	1000	5000	-33.13	PASS






Band2	15MHz	18900	16QAM	1	0	Low	5000	12000	-56.31	PASS
Band2	15MHz	18900	16QAM	1	0	Low	12000	26500	-41.24	PASS
Band2	15MHz	19125	16QAM	1	0	High	30	1000	-33.6	PASS
Band2	15MHz	19125	16QAM	1	0	High	1000	5000	-36.57	PASS
Band2	15MHz	19125	16QAM	1	0	High	5000	12000	-56.27	PASS
Band2	15MHz	19125	16QAM	1	0	High	12000	26500	-41.2	PASS
Band2	20MHz	18700	QPSK	1	0	Low	30	1000	-34.71	PASS
Band2	20MHz	18700	QPSK	1	0	Low	1000	5000	-33	PASS
Band2	20MHz	18700	QPSK	1	0	Low	5000	12000	-56.05	PASS
Band2	20MHz	18700	QPSK	1	0	Low	12000	26500	-41.13	PASS
Band2	20MHz	18900	QPSK	1	0	Low	30	1000	-33.79	PASS
Band2	20MHz	18900	QPSK	1	0	Low	1000	5000	-32.89	PASS
Band2	20MHz	18900	QPSK	1	0	Low	5000	12000	-56.04	PASS
Band2	20MHz	18900	QPSK	1	0	Low	12000	26500	-41.12	PASS
Band2	20MHz	19100	QPSK	1	0	High	30	1000	-34.73	PASS
Band2	20MHz	19100	QPSK	1	0	High	1000	5000	-30.74	PASS
Band2	20MHz	19100	QPSK	1	0	High	5000	12000	-56.3	PASS
Band2	20MHz	19100	QPSK	1	0	High	12000	26500	-40.9	PASS
Band2	20MHz	18700	16QAM	1	0	Low	30	1000	-34.21	PASS
Band2	20MHz	18700	16QAM	1	0	Low	1000	5000	-32.78	PASS
Band2	20MHz	18700	16QAM	1	0	Low	5000	12000	-56.18	PASS
Band2	20MHz	18700	16QAM	1	0	Low	12000	26500	-41.02	PASS
Band2	20MHz	18900	16QAM	1	0	Low	30	1000	-33.97	PASS
Band2	20MHz	18900	16QAM	1	0	Low	1000	5000	-33.04	PASS
Band2	20MHz	18900	16QAM	1	0	Low	5000	12000	-56.16	PASS
Band2	20MHz	18900	16QAM	1	0	Low	12000	26500	-41.21	PASS
Band2	20MHz	19100	16QAM	1	0	High	30	1000	-33.96	PASS
Band2	20MHz	19100	16QAM	1	0	High	1000	5000	-30.59	PASS
Band2	20MHz	19100	16QAM	1	0	High	5000	12000	-56.09	PASS
Band2	20MHz	19100	16QAM	1	0	High	12000	26500	-41.25	PASS






Test Graphs

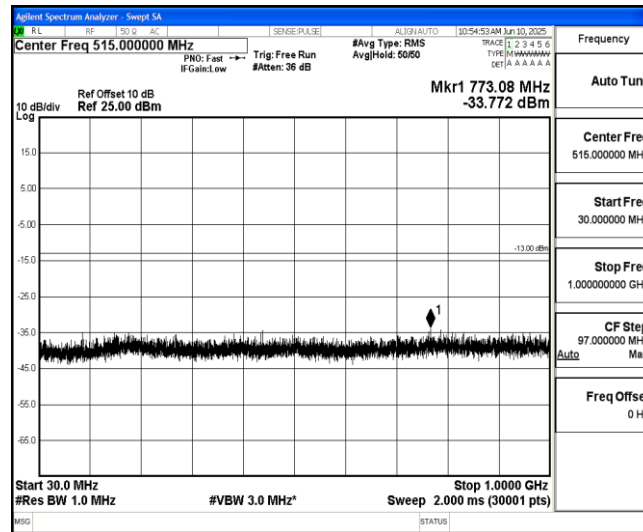

Band2-1.4MHz-QPSK-18607-1-0-Low-30-1000--33.77-PASS

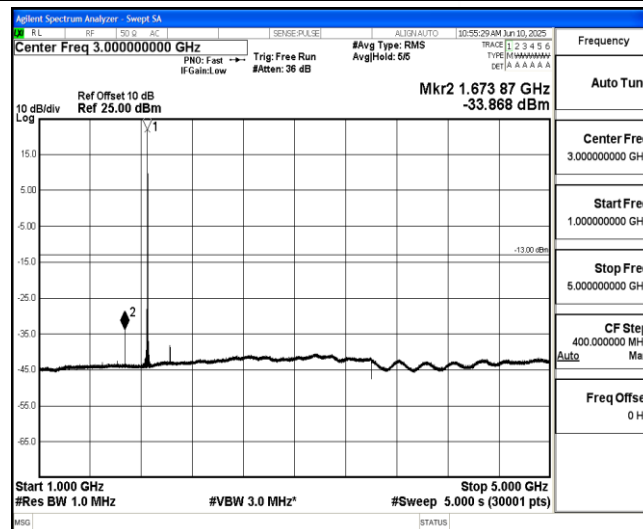

Band2-1.4MHz-QPSK-18607-1-0-Low-1000-5000--33.87-PASS

