

TIMCOENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com



Test Report

Product Name: 27 MHZ R/C TX

FCC ID: GLE136156

Applicant:

**SUNCON TOYS INDUSTRY LTD.
11/F, KAI TAK FACTORY BUILDING
99 KING FUK STREET, SANPOKONG,
KOWLOON, HONG KONG**

Date Receipt: NOVEMBER 21, 2002

Date Tested: DECEMBER 12, 2002

APPLICANT: SUNCON TOYS INDUSTRY LTD.

FCC ID: GLE136156

REPORT #: S\SUNCONGLE\1191UT2\1191UT2TestReport.doc

COVER SHEET

TIMCOENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

TABLE OF CONTENTS LIST

APPLICANT: SUNCON TOYS INDUSTRY LTD.

FCC ID: GLE136156

TEST REPORT CONTAINING:

PAGE 1-3....TEST EQUIPMENT LIST

PAGE 4.....TEST PROCEDURE

PAGE 5.....RADIATION INTERFERENCE TEST DATA

PAGE 6.....OCCUPIED BANDWIDTH

PAGE 7.....OCCUPIED BANDWIDTH PLOT

EXHIBITS CONTAINING:

EXHIBIT 1.....BLOCK DIAGRAM

EXHIBIT 2.....SCHEMATIC

EXHIBIT 3.....INSTRUCTION MANUAL

EXHIBIT 4.....SAMPLE OF FCC ID LABEL

EXHIBIT 5.....LOCATION OF FCC ID LABEL

EXHIBIT 6.....EXTERNAL PHOTOGRAPHS

EXHIBIT 7.....INTERNAL PHOTOGRAPHS

EXHIBIT 8.....CIRCUIT DESCRIPTION

EXHIBIT 9.....TEST SET-UP PHOTOGRAPH

APPLICANT: SUNCON TOYS INDUSTRY LTD.

FCC ID: GLE136156

REPORT #: S\SUNCONGLE\1191UT2\1191UT2TestReport.doc

TABLE OF CONTENTS

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

EMC Equipment List

| | DEVICE | MFGR | MODEL | SERNO | CAL/CHAR DATE | DUE DATE or STATUS |
|---|---|-----------------|---------------|--------------------------|-----------------|--------------------|
| X | 3-Meter OATS | TEI | N/A | N/A | Listed 12/22/99 | 12/22/02 |
| | 3/10-Meter OATS | TEI | N/A | N/A | Listed 3/26/01 | 3/26/04 |
| | Receiver, Beige Tower Spectrum Analyzer (Tan) | HP | 8566B Opt 462 | 3138A07786 3144A20661 | CAL 8/31/01 | 8/31/03 |
| | RF Preselector (Tan) | HP | 85685A | 3221A01400 | CAL 8/31/01 | 8/31/03 |
| | Quasi-Peak Adapter (Tan) | HP | 85650A | 3303A01690 | CAL 8/31/01 | 8/31/03 |
| X | Receiver, Blue Tower Spectrum Analyzer (Blue) | HP | 8568B | 2928A04729 | CHAR 10/22/01 | 10/22/03 |
| X | RF Preselector (Blue) | HP | 85685A | 2848A18049 2926A00983 | CHAR 10/22/01 | 10/22/03 |
| X | Quasi-Peak Adapter (Blue) | HP | 85650A | 2811A01279 | CHAR 10/22/01 | 10/22/03 |
| X | Biconnical Antenna | Electro-Metrics | BIA-25 | 1171 | CAL 4/26/01 | 4/26/03 |
| | Biconnical Antenna | Eaton | 94455-1 | 1096 | CAL 10/1/01 | 10/1/03 |
| | Biconnical Antenna | Eaton | 94455-1 | 1057 | CHAR 3/15/00 | 3/15/02 |
| | BiconiLog Antenna | EMCO | 3143 | 9409-1043 | | |
| X | Log-Periodic Antenna | Electro-Metrics | LPA-25 | 1122 | CAL 10/2/01 | 10/2/03 |
| | Log-Periodic Antenna | Electro-Metrics | EM-6950 | 632 | CHAR 10/15/01 | 10/15/03 |
| | Log-Periodic Antenna | Electro-Metrics | LPA-30 | 409 | CHAR 10/16/01 | 10/16/03 |
| | Dipole Antenna Kit | Electro-Metrics | TDA-30/1-4 | 152 | CAL 3/21/01 | 3/21/04 |
| | Dipole Antenna Kit | Electro-Metrics | TDA-30/1-4 | 153 | CHAR 11/24/00 | 11/24/03 |
| | Double-Ridged Horn Antenna | Electro-Metrics | RGA-180 | 2319 | CAL 12/19/01 | 12/19/03 |
| | Horn Antenna | Electro-Metrics | EM-6961 | 6246 | CAL 3/21/01 | 3/21/03 |

APPLICANT: SUNCON TOYS INDUSTRY LTD.

FCC ID: GLE136156

REPORT #: S\SUNCONGLE\1191UT2\1191UT2TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

| | DEVICE | MFGR | MODEL | SERNO | CAL/CHAR DATE | DUE DATE or STATUS |
|---|---------------------------------------|--------------------------------|------------|------------|--------------------|-----------------------|
| | Horn Antenna | ATM | 19-443-6R | None | No Cal Required | |
| | Passive Loop Antenna | EMC Test Systems | EMCO 6512 | 9706-1211 | CHAR 7/10/01 | 7/10/03 |
| | Line Impedance Stabilization . . . | Electro-Metrics | ANS-25/2 | 2604 | CAL 10/9/01 | 10/9/03 |
| | Line Impedance Stabilization . . . | Electro-Metrics | EM-7820 | 2682 | CAL 3/16/01 | 3/16/03 |
| | Termaline Wattmeter | Bird Electronic Corporation | 611 | 16405 | CAL 5/25/99 | 5/25/01 |
| | Termaline Wattmeter | Bird Electronic Corporation | 6104 | 1926 | CAL 12/12/01 | 12/12/03 |
| | Oscilloscope | Tektronix | 2230 | 300572 | CHAR 2/1/01 | 2/1/03 |
| | Temperature Chamber | Tenney Engineering | TTRC | 11717-7 | CHAR 1/22/02 | 1/22/04 |
| | AC Voltmeter | HP | 400FL | 2213A14499 | CAL 10/9/01 | 10/9/03 |
| | AC Voltmeter | HP | 400FL | 2213A14261 | CHAR 10/15/01 | 10/15/03 |
| | AC Voltmeter | HP | 400FL | 2213A14728 | CHAR 10/15/01 | 10/15/03 |
| X | Digital Multimeter | Fluke | 77 | 35053830 | CHAR 1/8/02 | 1/8/04 |
| | Digital Multimeter | Fluke | 77 | 43850817 | CHAR 1/8/02 | 1/8/04 |
| | Digital Multimeter | HP | E2377A | 2927J05849 | CHAR 1/8/02 | 1/8/04 |
| | Multimeter | Fluke | FLUKE-77-3 | 79510405 | CAL 9/26/01 | 9/26/03 |
| | Peak Power Meter | HP | 8900C | 2131A00545 | CHAR 1/26/01 | 1/26/03 |
| | Digital Thermometer | Fluke | 2166A | 42032 | CAL 1/16/02 | 1/16/04 |
| | Thermometer | Traulsen | SK-128 | | CHAR 1/22/02 | 1/22/04 |
| X | Temp/Humidity gauge | EXTech | 44577F | E000901 | CHAR 1/22/02 | 1/22/04 |
| | Frequency Counter | HP | 5352B | 2632A00165 | CAL 11/28/01 | 11/28/03 |
| | Power Sensor | Agilent Technologies | 84811A | 2551A02705 | CAL 1/26/01 | 1/26/03 |

APPLICANT: SUNCON TOYS INDUSTRY LTD.

FCC ID: GLE136156

REPORT #: S\SUNCONGLE\1191UT2\1191UT2TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

| | DEVICE | MFGR | MODEL | SERNO | CAL/CHAR DATE | DUE DATE or STATUS |
|--|----------------------|---------------------|----------------------|------------|------------------|-----------------------|
| | Service Monitor | IFR | FM/AM 500A | 5182 | CAL 11/22/00 | 11/22/02 |
| | Comm. Serv. Monitor | IFR | FM/AM 1200S | 6593 | CAL 5/12/02 | 5/12/04 |
| | Signal Generator | HP | 8640B | 2308A21464 | CAL 11/15/01 | 11/15/03 |
| | Modulation Analyzer | HP | 8901A | 3435A06868 | CAL 9/5/01 | 9/5/03 |
| | Near Field Probe | HP | HP11940A | 2650A02748 | CHAR 2/1/01 | 2/1/03 |
| | BandReject Filter | Lorch Microwave | 5BR4-2400/ 60-N | Z1 | CHAR 3/2/01 | 3/2/03 |
| | BandReject Filter | Lorch Microwave | 6BR6-2442/ 300-N | Z1 | CHAR 3/2/01 | 3/2/03 |
| | BandReject Filter | Lorch Microwave | 5BR4-10525/ 900-S | Z1 | CHAR 3/2/01 | 3/2/03 |
| | High Pas Filter | Microlab | HA-10N | | CHAR 10/4/01 | 10/4/03 |
| | Audio Oscillator | HP | 653A | 832-00260 | CHAR 3/1/01 | 3/1/03 |
| | Frequency Counter | HP | 5382A | 1620A03535 | CHAR 3/2/01 | 3/2/03 |
| | Frequency Counter | HP | 5385A | 3242A07460 | CHAR 12/11/01 | 12/11/03 |
| | Preamplifier | HP | 8449B-H02 | 3008A00372 | CHAR 3/4/01 | 3/4/03 |
| | Amplifier | HP | 11975A | 2738A01969 | CHAR 3/1/01 | 3/1/03 |
| | Egg Timer | Unk | | | CHAR 8/31/01 | 8/31/03 |
| | Measuring Tape, 20M | Kraftixx | 0631-20 | | CHAR 2/1/02 | 2/1/04 |
| | Measuring Tape, 7.5M | Kraftixx | 7.5M PROFI | | 2/1/02 | 2/1/04 |
| | Coaxial Cable #51 | Insulated Wire Inc. | NPS 2251-2880 | Timco #51 | CHAR 1/23/02 | 1/23/04 |
| | Coaxial Cable #64 | Semflex Inc. | 60637 | Timco #64 | CHAR 1/24/02 | 1/24/04 |
| | Coaxial Cable #65 | General Cable Co. | E9917 RG233/U | Timco #65 | CHAR 1/23/02 | 1/23/04 |
| | Coaxial Cable #106 | Unknown | Unknown | Timco #106 | CHAR 1/23/02 | 1/23/04 |

APPLICANT: SUNCON TOYS INDUSTRY LTD.

FCC ID: GLE136156

REPORT #: S\SUNCONGLE\1191UT2\1191UT2TestReport.doc

TIMCO ENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

TEST PROCEDURE

GENERAL: This report shall NOT be reproduced except in full without the written approval of TIMCO ENGINEERING, INC.

RADIATION INTERFERENCE: The test procedure used was ANSI STANDARD C63.4-1992 using a HEWLETT PACKARD spectrum analyzer with a preselector. The bandwidth of the spectrum analyzer was 100 kHz with an appropriate sweep speed. The analyzer was calibrated in dB above a microvolt at the output of the antenna. The resolution bandwidth was 100 kHz and the video bandwidth was 300 kHz. The ambient temperature of the UUT was 60°C with a humidity of 60%.

FORMULA OF CONVERSION FACTORS: The Field Strength at 3m was established by adding the meter reading of the spectrum analyzer (which is set to read in units of dBuV) to the antenna correction factor supplied by the antenna manufacturer. The antenna correction factors are stated in terms of dB. The gain of the Preselector was accounted for in the Spectrum Analyzer Meter Reading.

Example:

| | |
|------------|--|
| Freq (MHz) | METER READING + ACF = FS |
| 33 | 20 dBuV + 10.36 dB = 30.36 dBuV/m @ 3m |

ANSI STANDARD C63.4-1992 10.1.7 MEASUREMENT PROCEDURES: The unit under test was placed on a table 80 cm high and with dimensions of 1m by 1.5m. The table used for radiated measurements is capable of continuous rotation.

When an emission was found, the table was rotated to produce the maximum signal strength. At this point, the antenna was raised and lowered from 1m to 4m. The antenna was placed in both the horizontal and vertical planes.

APPLICANT: SUNCON TOYS INDUSTRY LTD.
FCC ID: GLE136156
REPORT #: S\SUNCONGLE\1191UT2\1191UT2TestReport.doc

TIMCOENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

APPLICANT: SUNCON TOYS INDUSTRY LTD.

FCC ID: GLE136156

NAME OF TEST: RADIATION INTERFERENCE

RULES PART NO.: 15.227

REQUIREMENTS: CARRIER FREQUENCY WILL NOT EXCEED 80 dBuV/m AT 3M.
OUT-OF-BAND EMISSIONS SHALL NOT EXCEED:

| | |
|---------------|----------------------------------|
| 30 - 88 MHz | 40.0 dBuV/M MEASURED AT 3 METERS |
| 88 - 216 MHz | 43.5 dBuV/M |
| 216 - 960 MHz | 46.0 dBuV/M |
| ABOVE 960 MHz | 54.0 dBuV/M |

TEST DATA:

| Emission Frequency MHz | Meter Reading dBuV | Ant. Polarity | Coax Loss dB | Correction Factor dB | Field Strength dBuV/m | Margin dB |
|------------------------------|--------------------------|------------------|--------------------|----------------------------|-----------------------------|--------------|
| 27.10 | 38.6 | H | 0.31 | 13.96 | 52.87 | 27.14 |
| 27.10 | 63.3 | V | 0.31 | 13.96 | 77.57 | 2.44 |
| 54.20 | 14.7 | V | 0.84 | 10.37 | 25.91 | 14.09 |
| 81.40 | 16.6 | V | 1.06 | 8.96 | 26.62 | 13.38 |

SAMPLE CALCULATION: FSdBuV/m = MR(dBuV) + ACFdB.

TEST PROCEDURE: The procedure used was ANSI STANDARD C63.4-1992. The spectrum was scanned from 30 MHz to 1000 MHz. When an emission was found, the table was rotated to produce the maximum signal strength. The antenna was placed in both the horizontal and vertical planes and the worse case emissions were reported. The UUT was tested in 3 orthogonal planes.

TEST RESULTS: THE UNIT DOES MEET THE FCC REQUIREMENTS.

PERFORMED BY: JOSEPH SCOGLIO

DATE: DECEMBER 12, 2002

APPLICANT: SUNCON TOYS INDUSTRY LTD.
FCC ID: GLE136156
REPORT #: S\SUNCONGLE\1191UT2\1191UT2TestReport.doc

TIMCOENGINEERING INC.

849 NW State Road 45
Newberry, Florida 32669
<http://www.timcoengr.com>
888.472.2424 F 352.472.2030 email: sid@timcoengr.com

APPLICANT: SUNCON TOYS INDUSTRY LTD.

FCC ID: GLE136156

NAME OF TEST: Occupied Bandwidth

RULES PART NO.: 15.227

REQUIREMENTS: The field strength of any emissions appearing between the band edges and up to 10 kHz above and below the band edges shall be attenuated to the general limits of 15.209.

THE GRAPH ON THE NEXT PAGE REPRESENTS THE EMISSIONS TAKEN FOR THE DEVICE.

METHOD OF MEASUREMENT: A small sample of the transmitter output was fed into the spectrum analyzer and the attached plot was taken. The vertical scale is set to 10 dB per division. The horizontal scale is set to 10 kHz per division.

TEST RESULTS: The unit DOES meet the FCC requirements.

PERFORMED BY: JOSEPH SGOGLIO

DATE: DECEMBER 12, 2002

APPLICANT: SUNCON TOYS INDUSTRY LTD.
FCC ID: GLE136156
REPORT #: S\SUNCONGLE\1191UT2\1191UT2TestReport.doc

TIMCO ENGINEERING INC.


849 NW State Road 45

Newberry, Florida 32669

<http://www.timcoengr.com>

888.472.2424 F 352.472.2030 email: sid@timcoengr.com

OCCUPIED BANDWIDTH PLOT

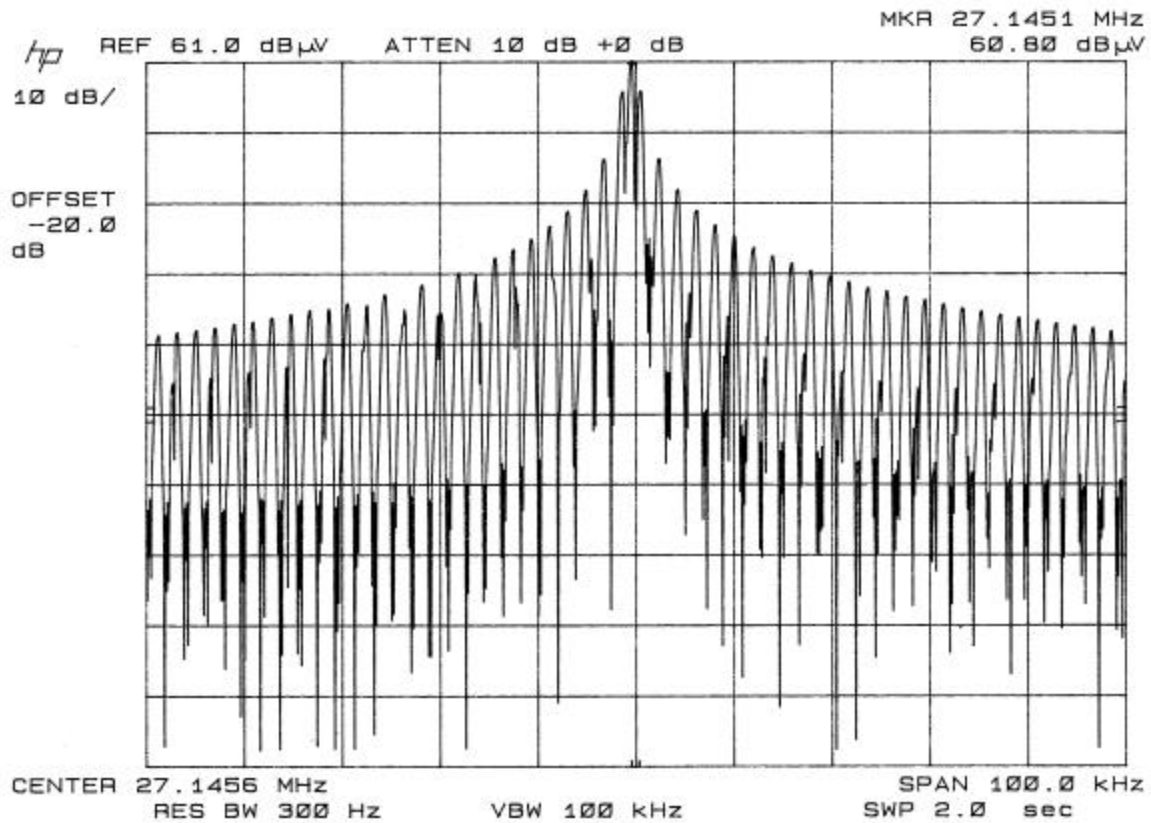

APPLICANT: SUNCON TOYS INDUSTRY LTD.

FCC ID: GLE136156

REPORT #: S\SUNCONGLE\1191UT2\1191UT2TestReport.doc